




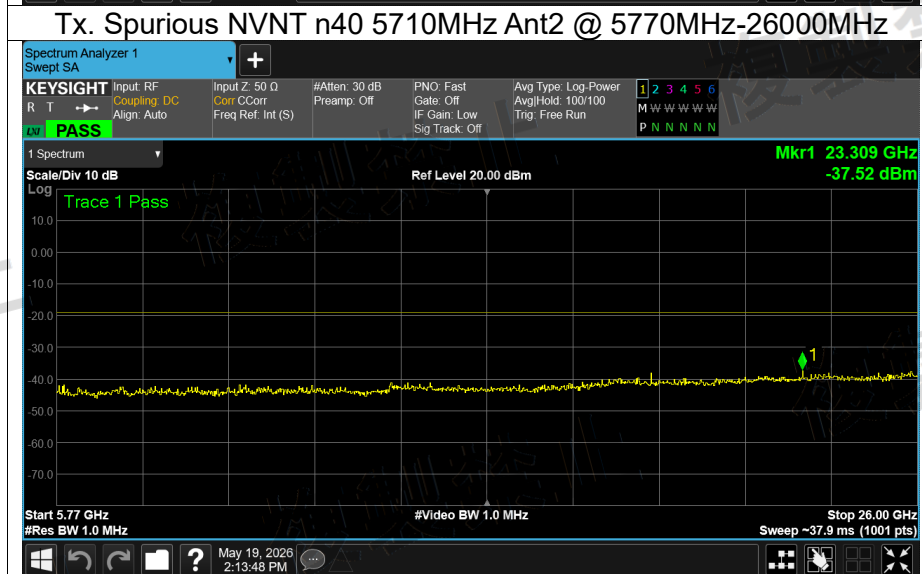
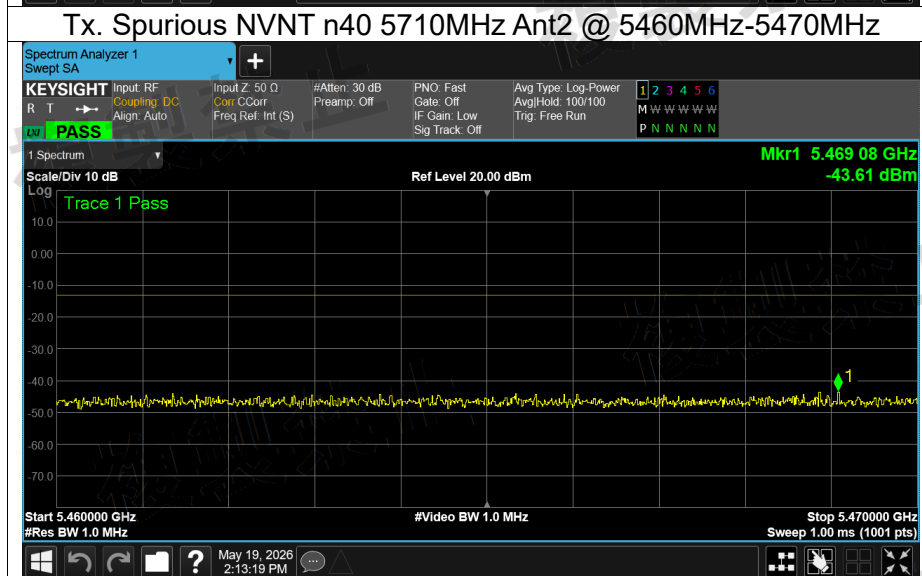
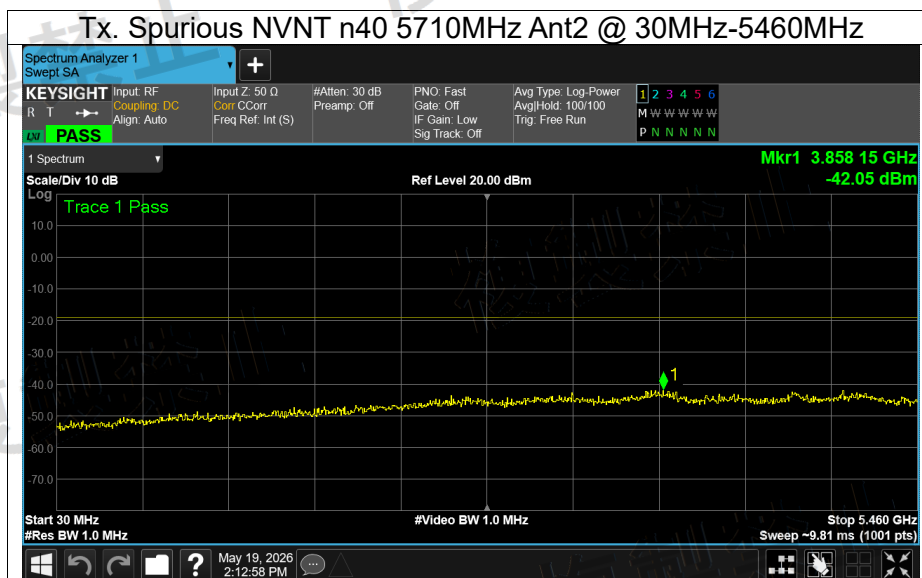
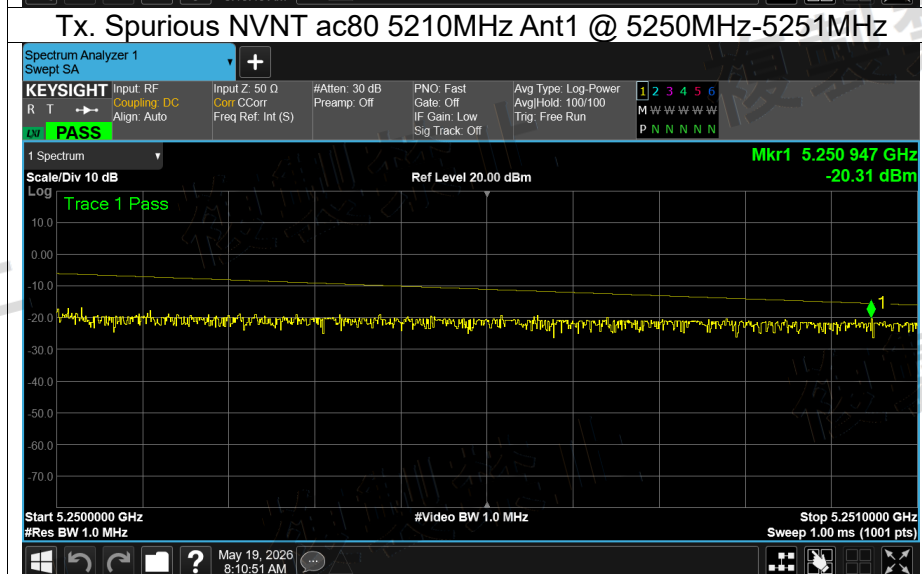
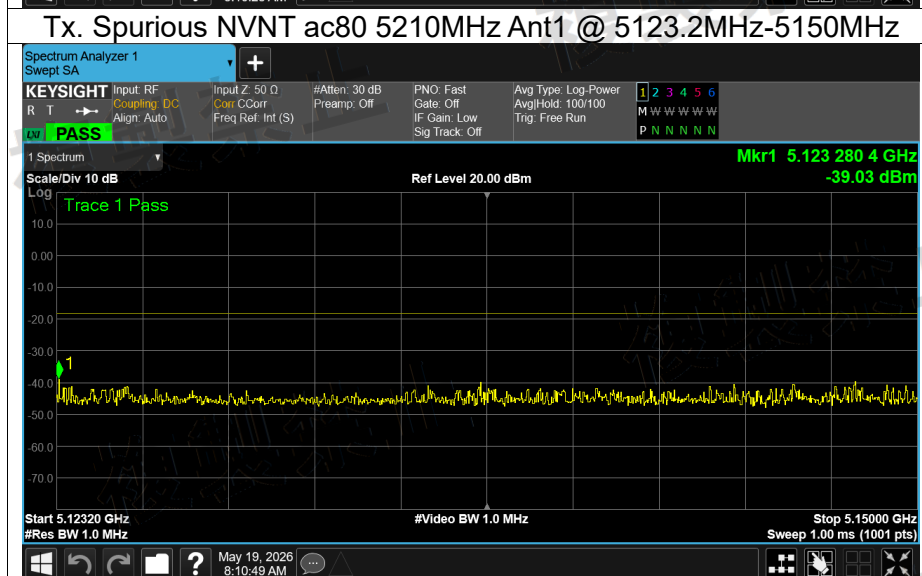
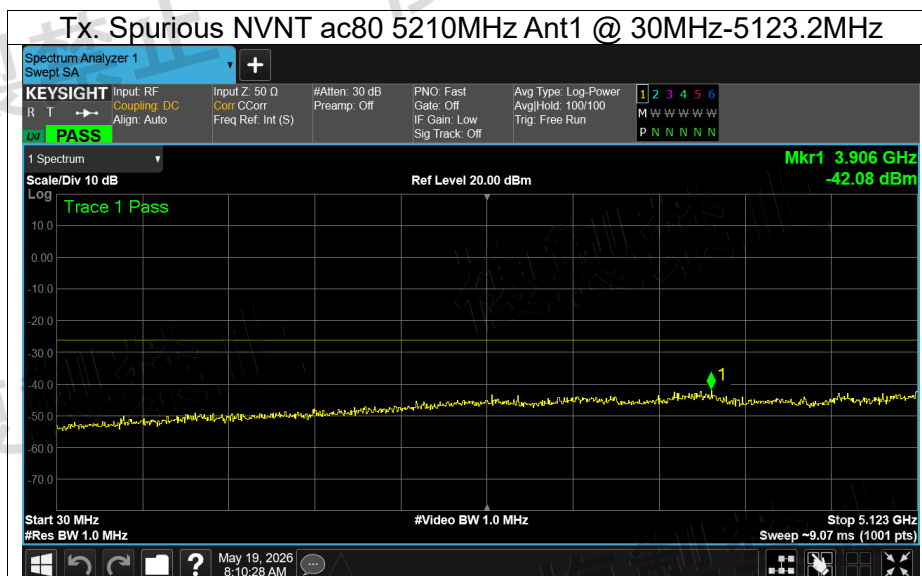
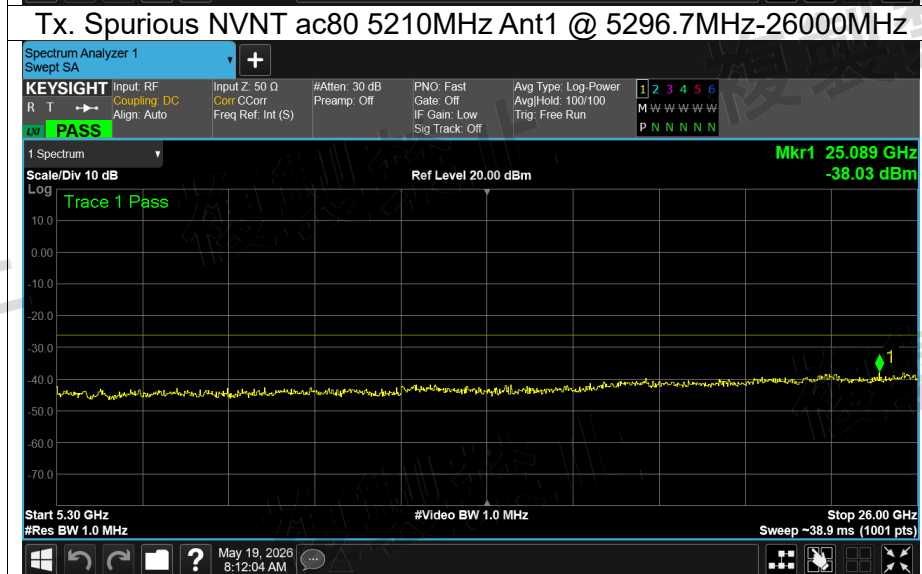
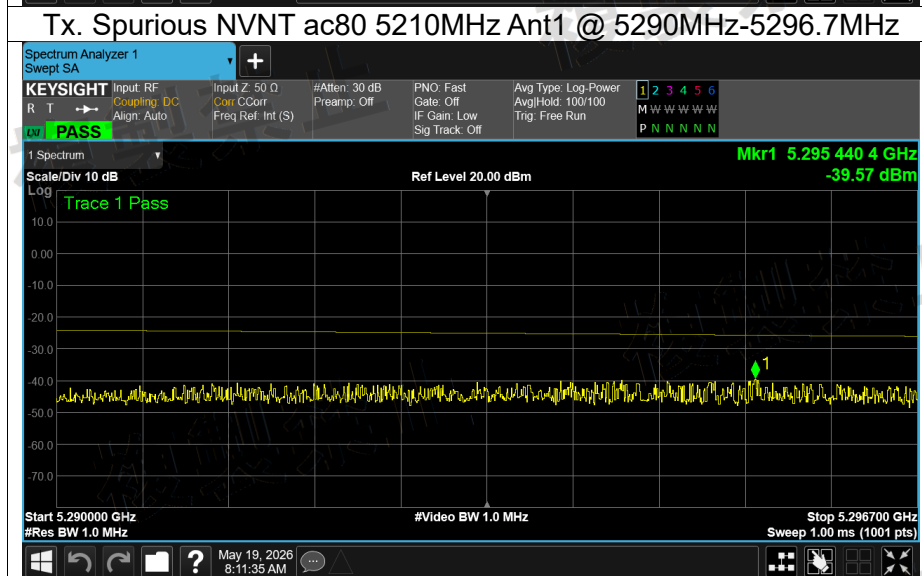
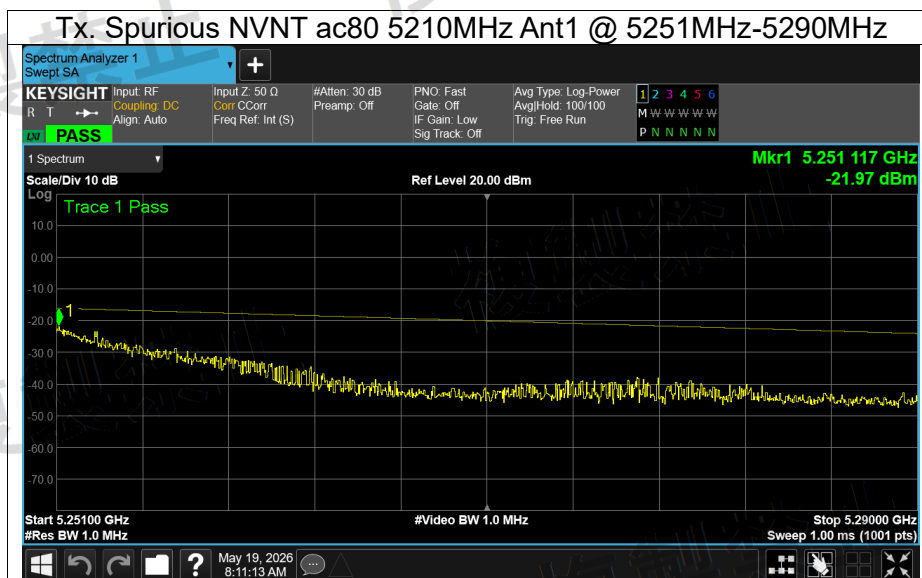
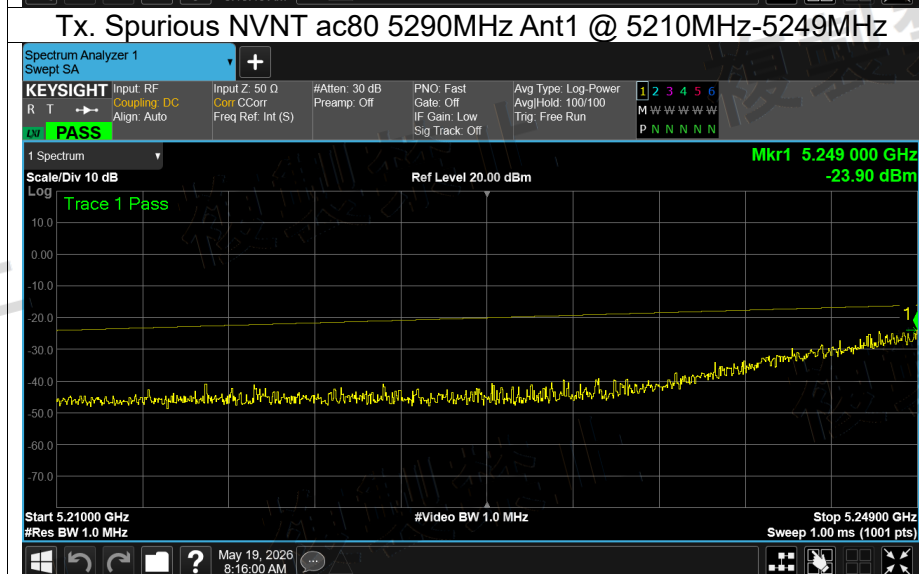




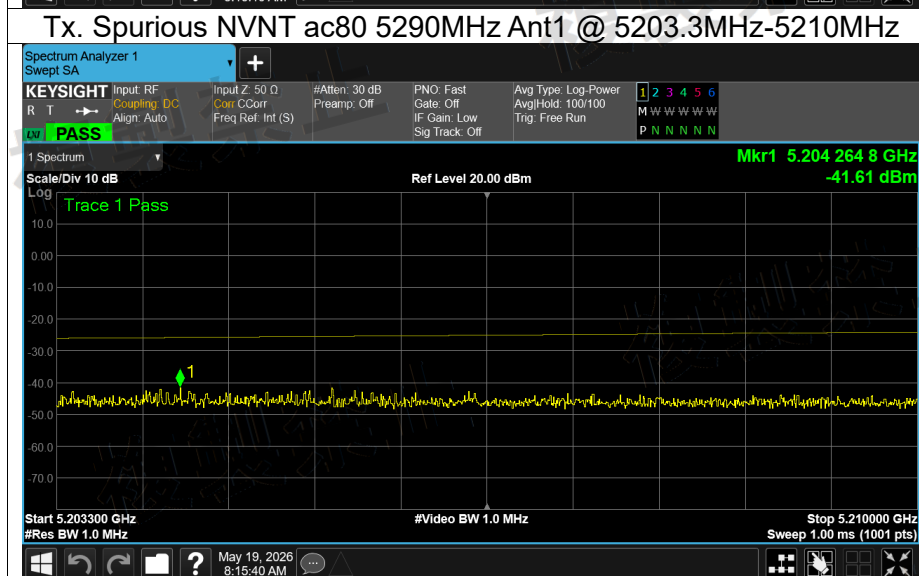




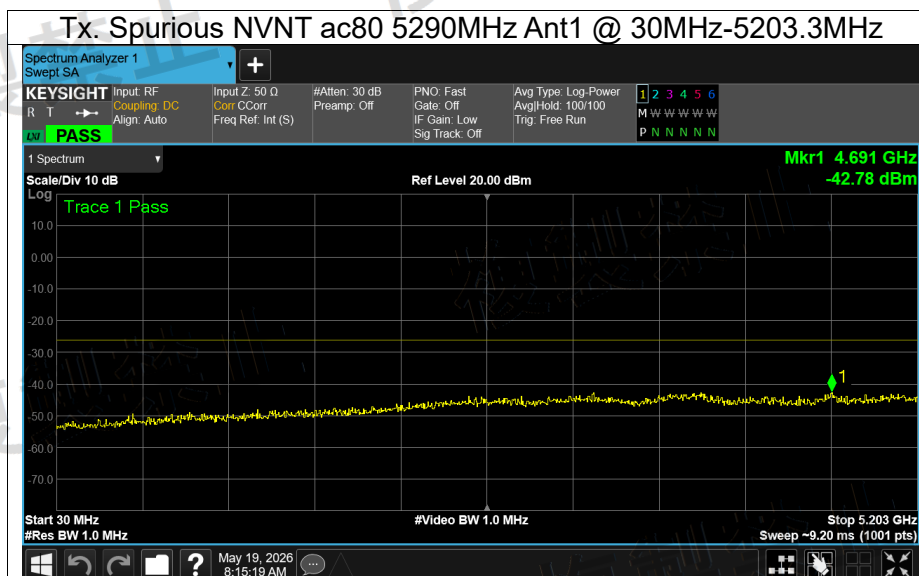




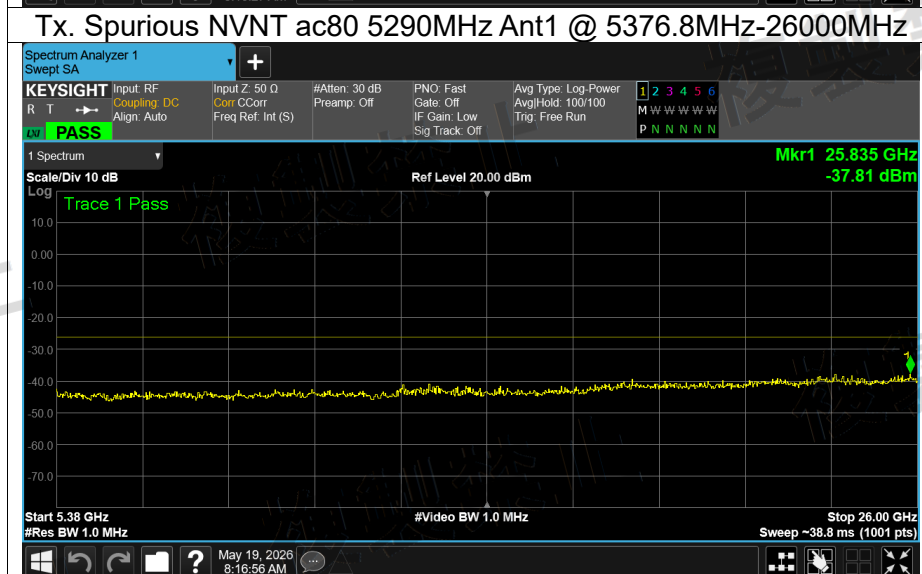




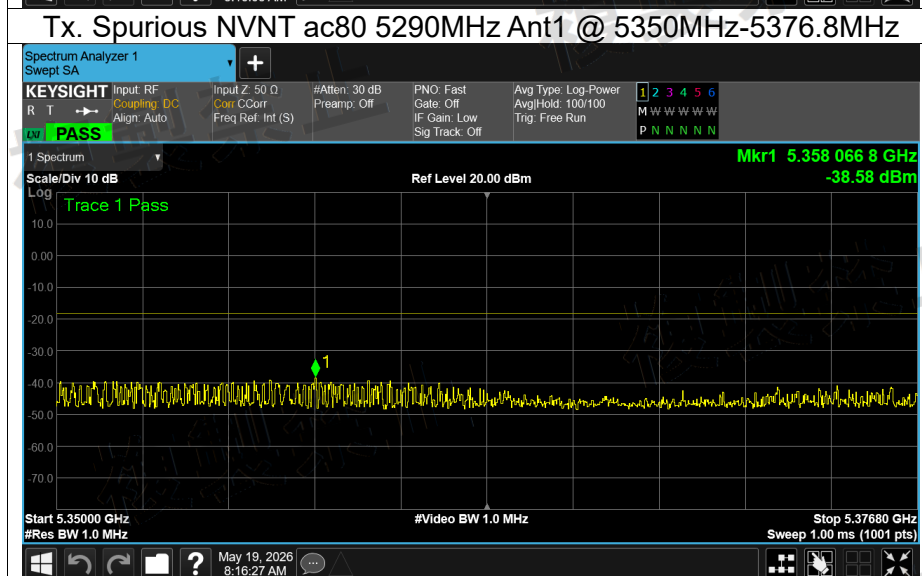




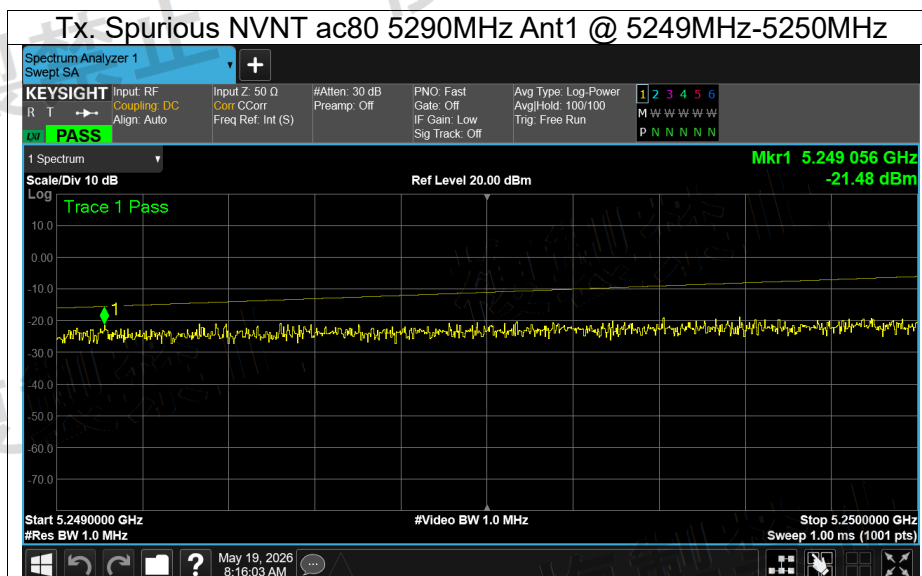


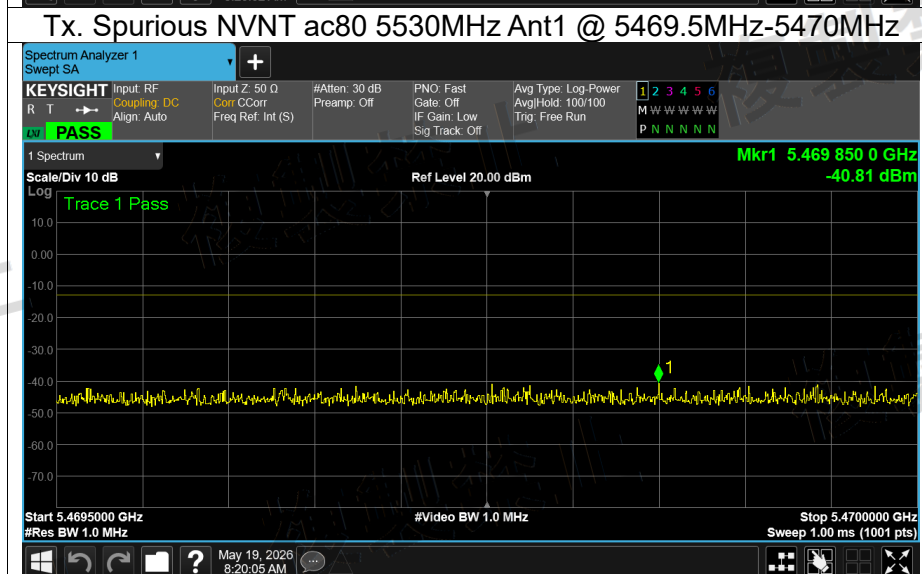
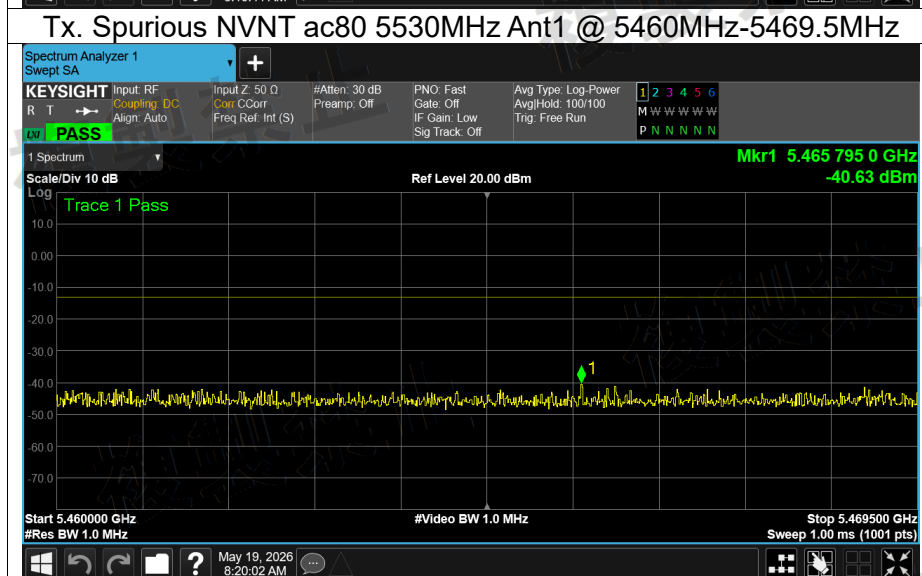
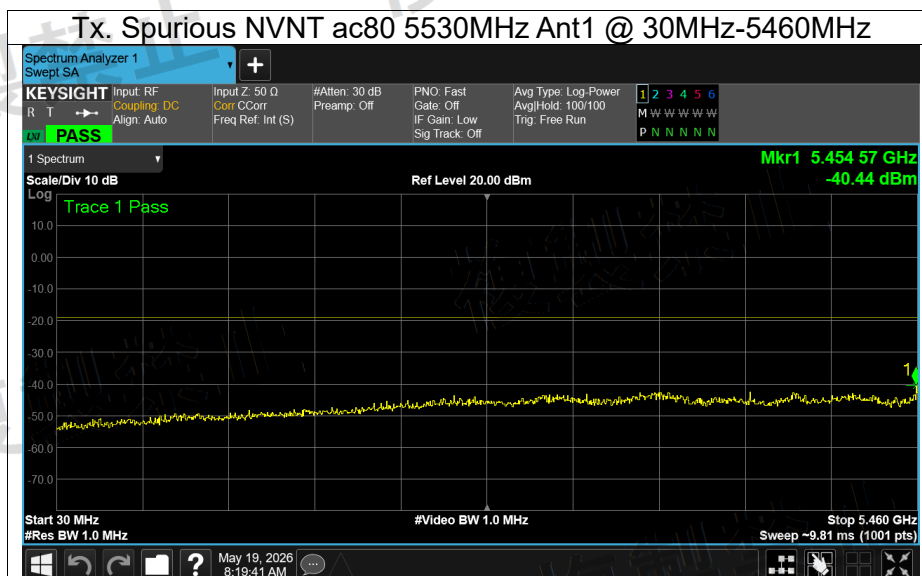


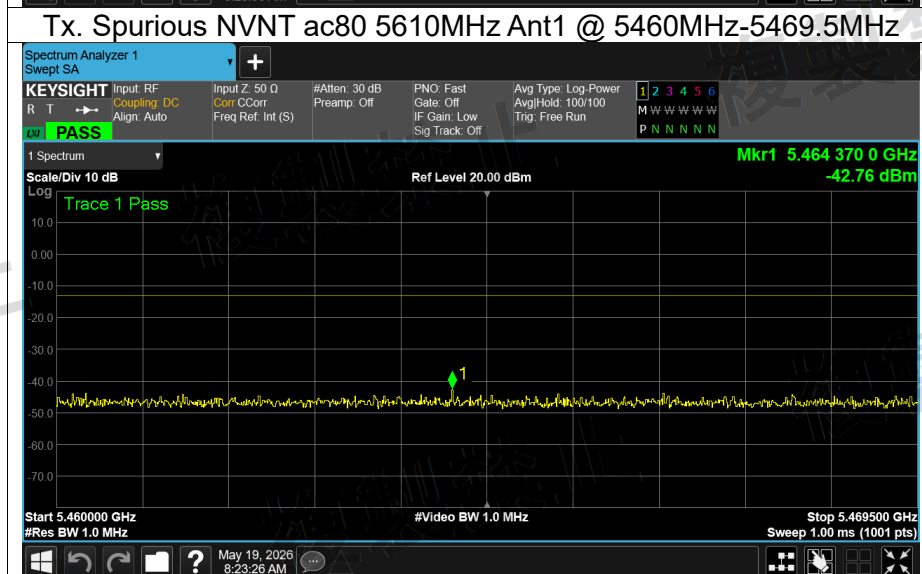
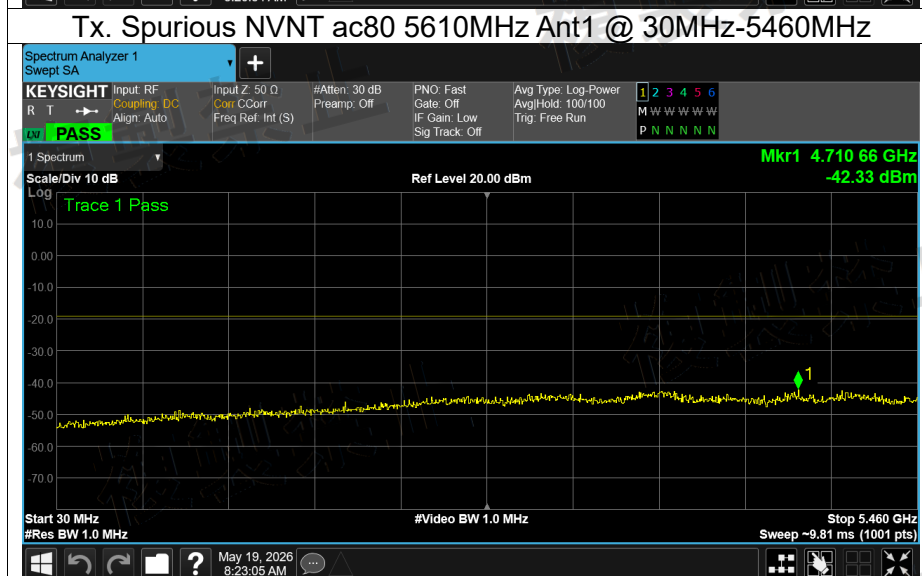
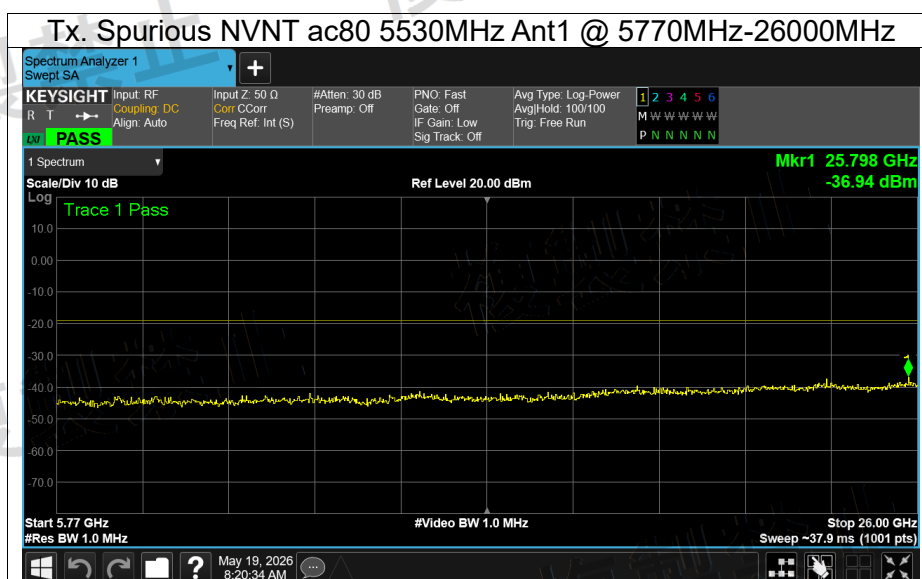


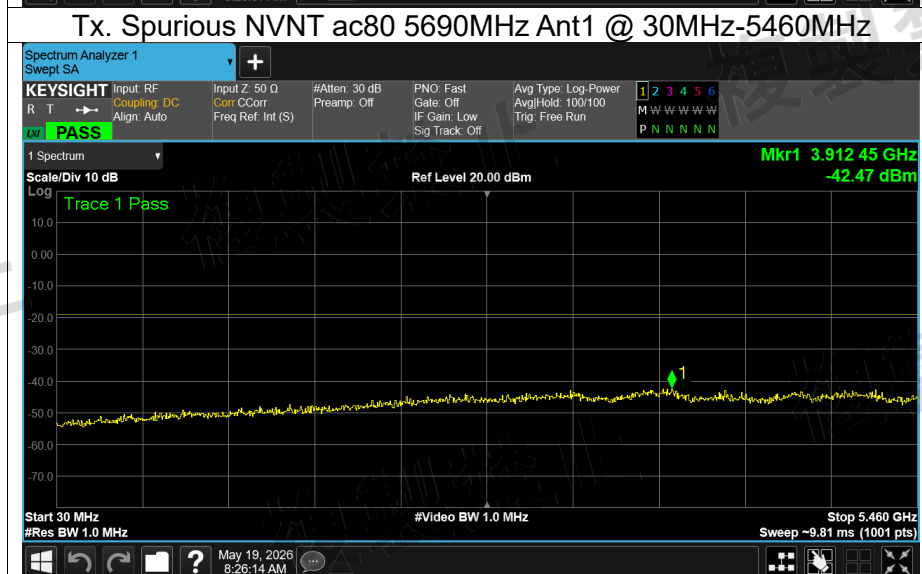
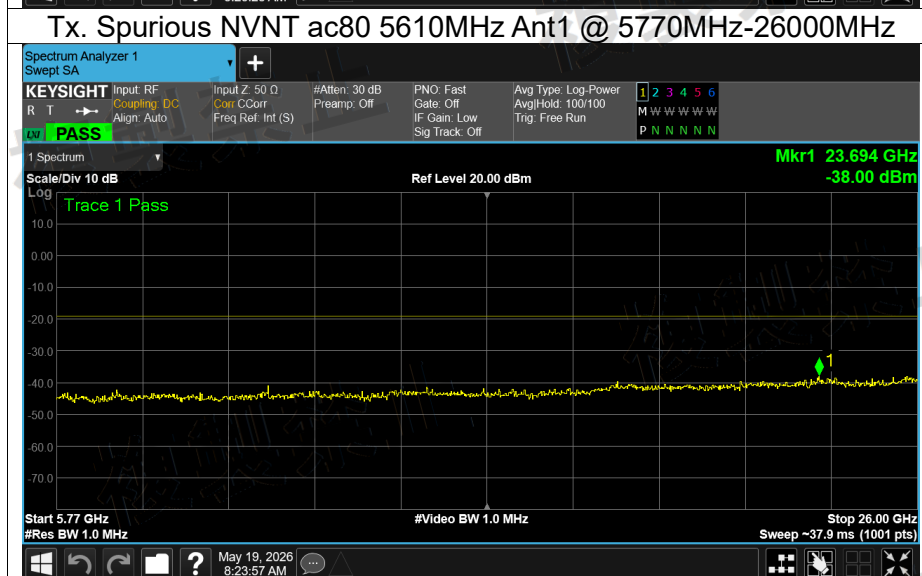
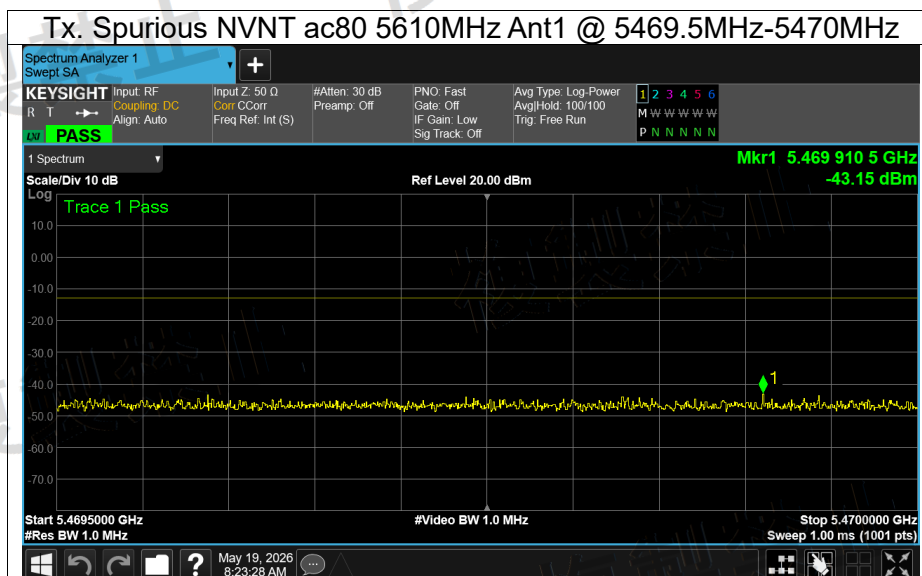


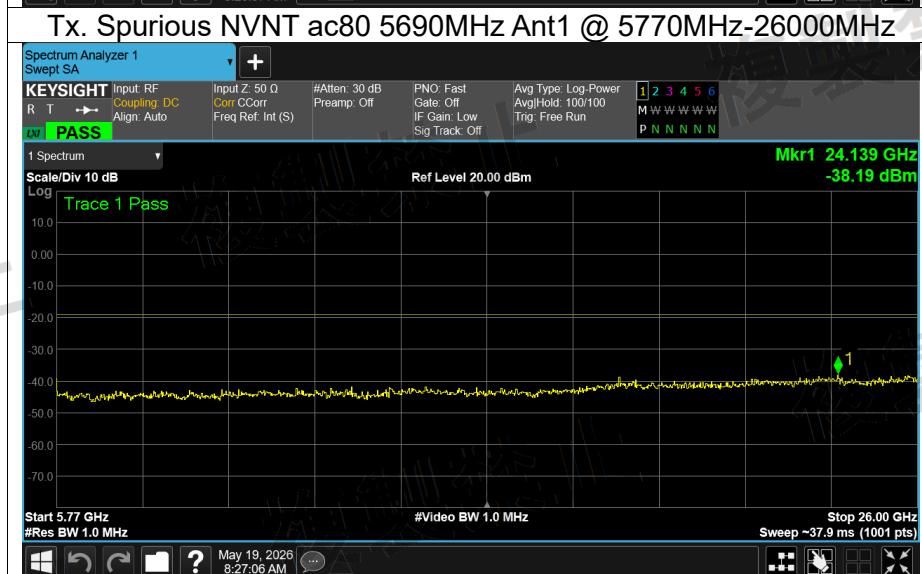
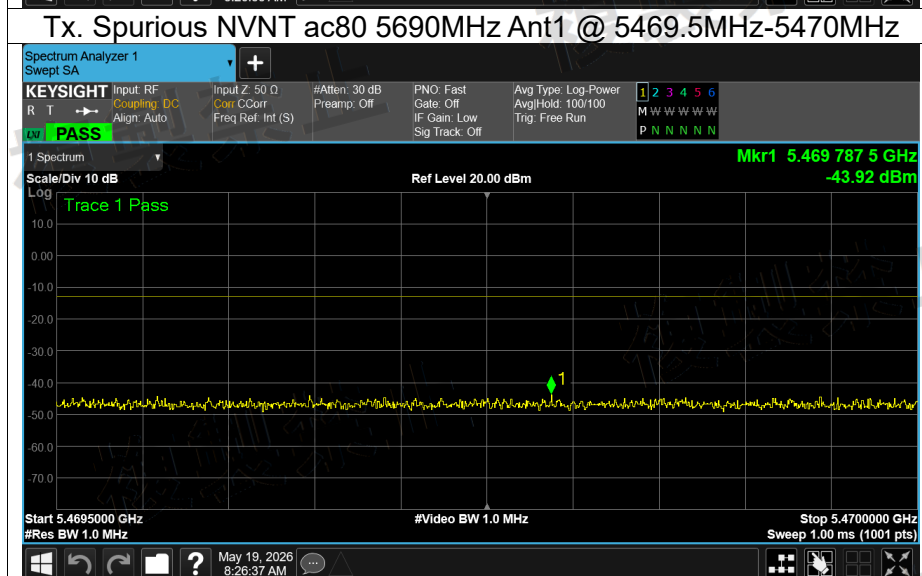
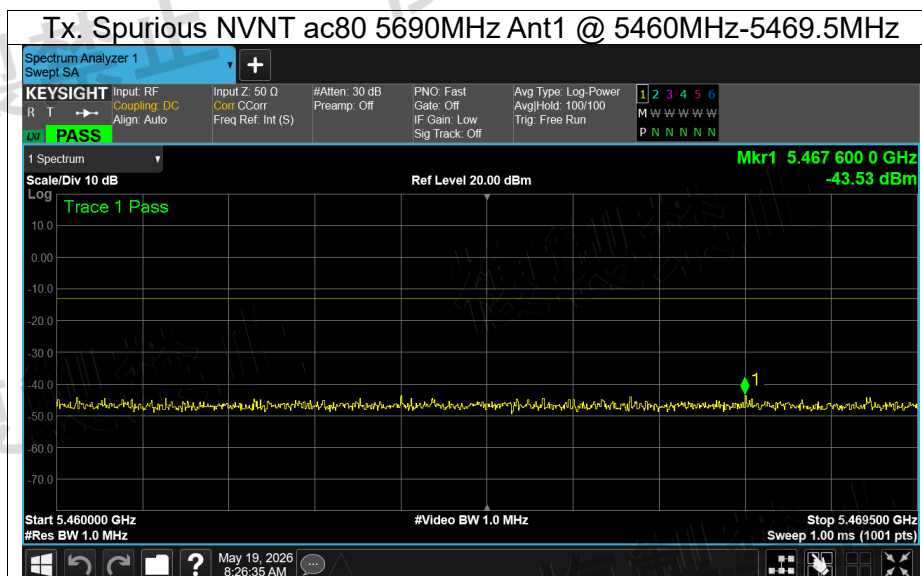


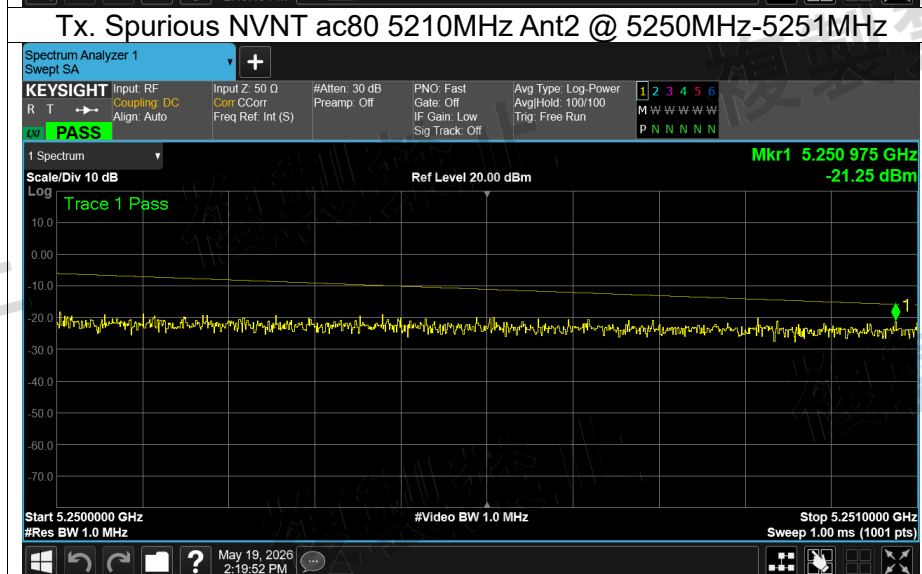
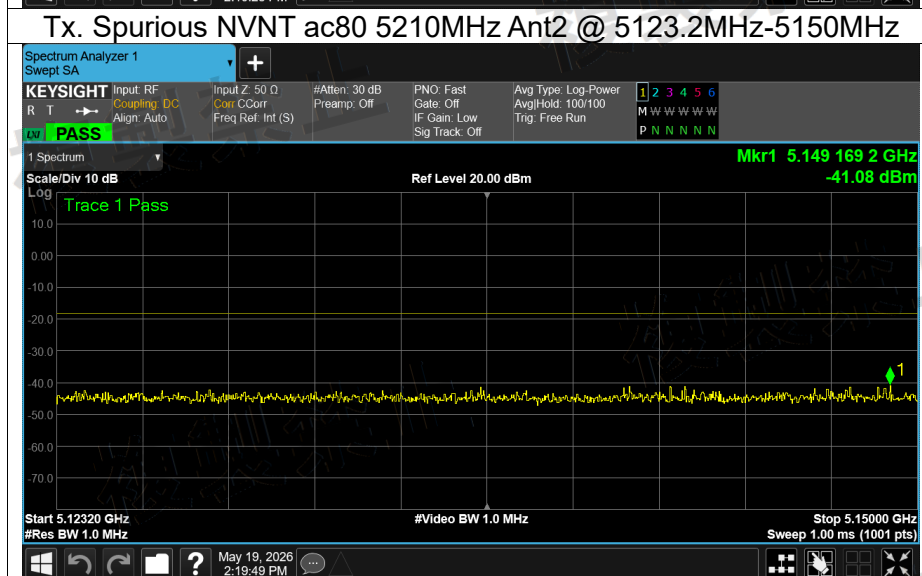
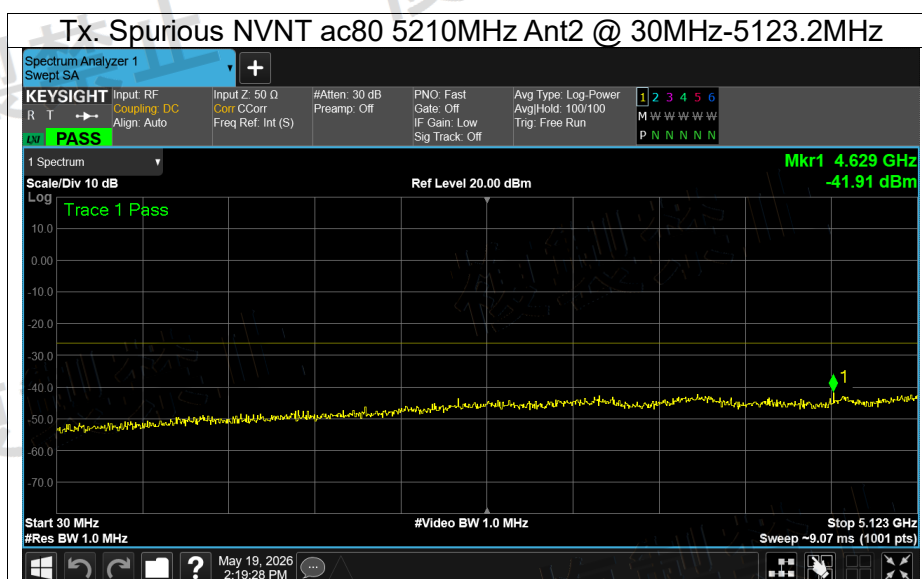


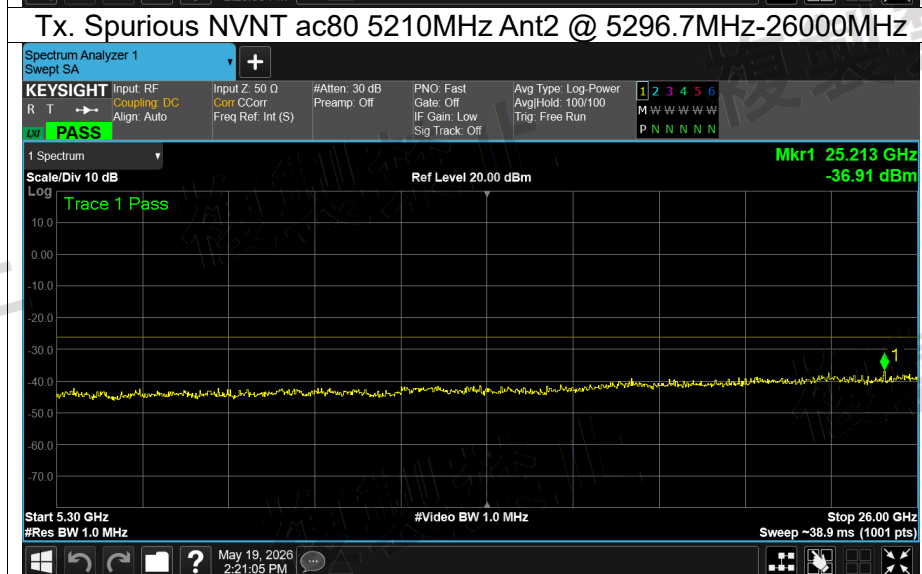
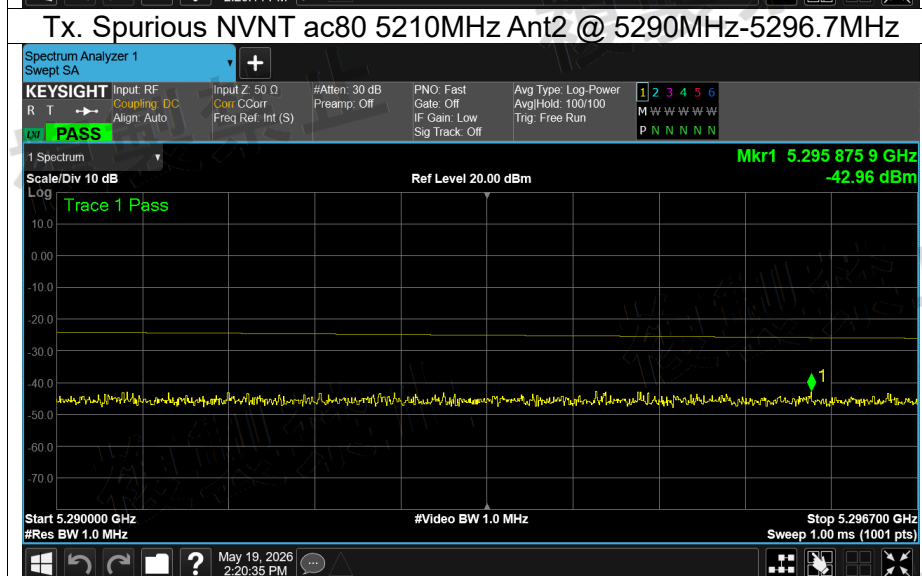
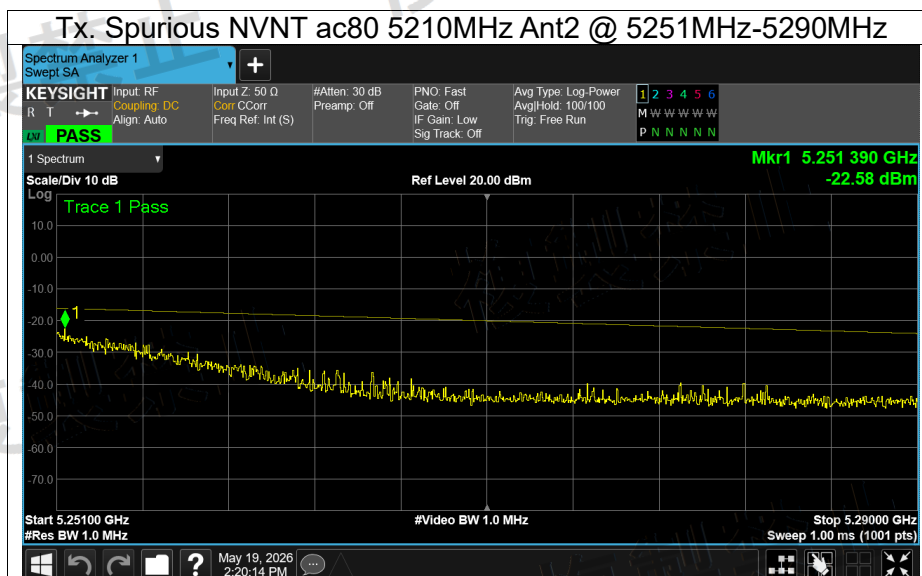


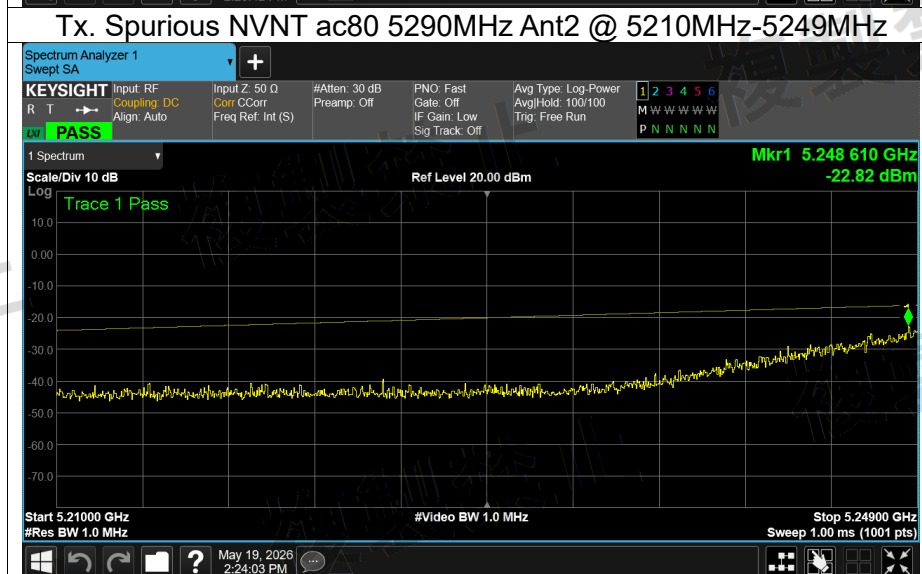
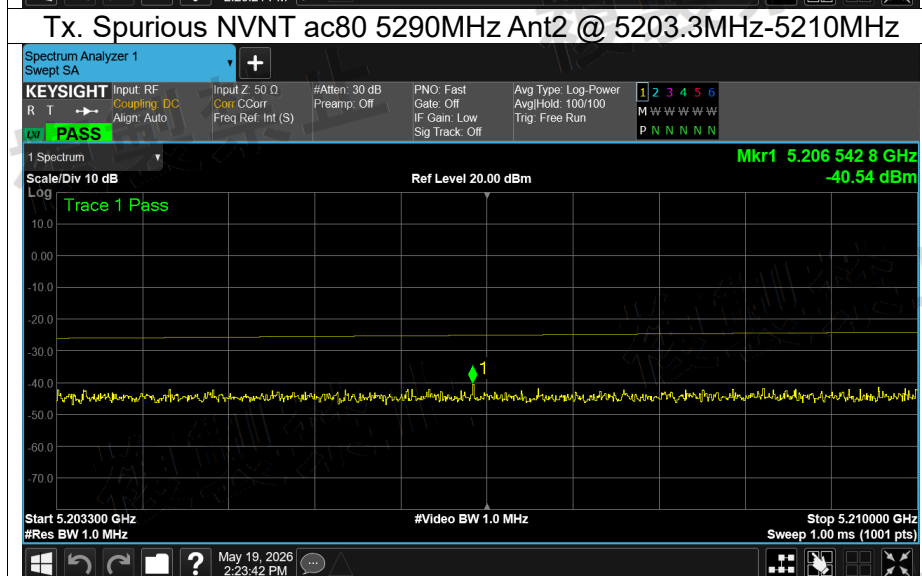
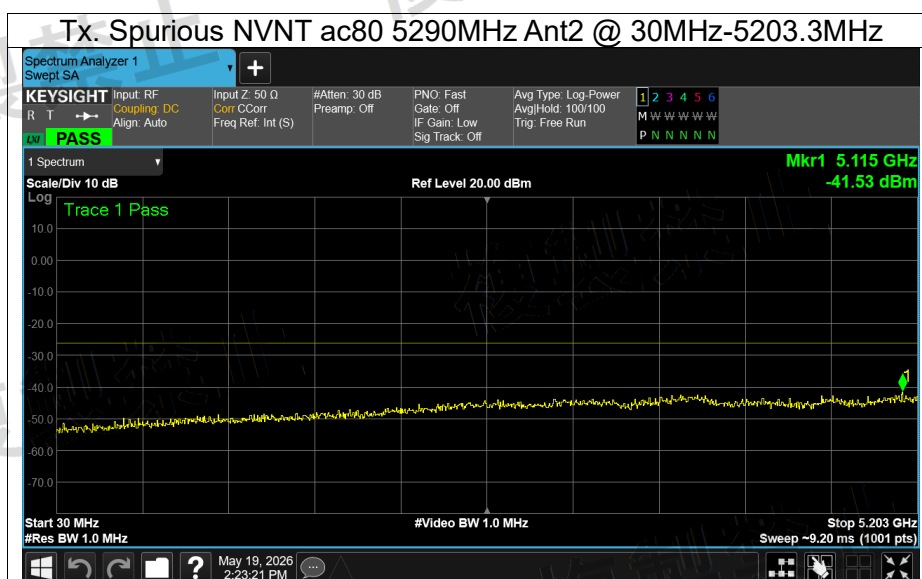


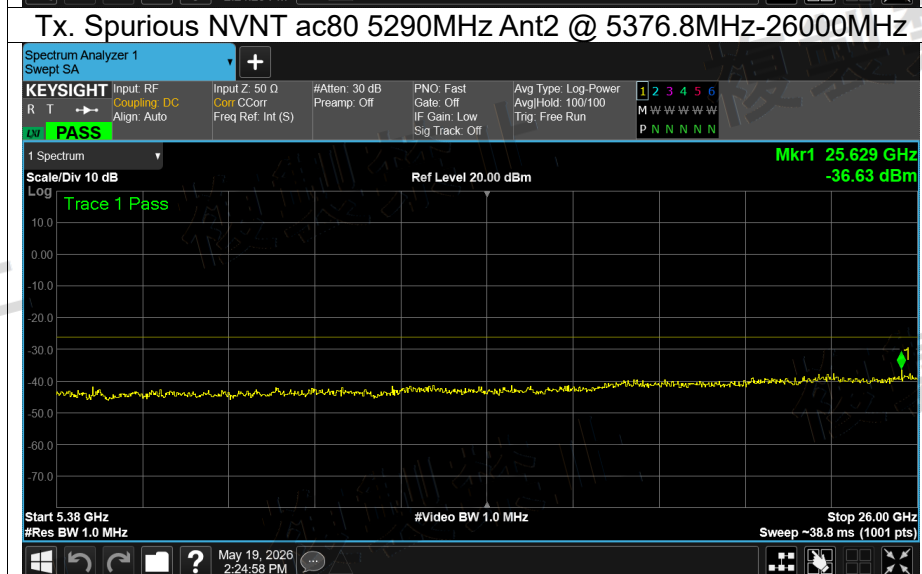
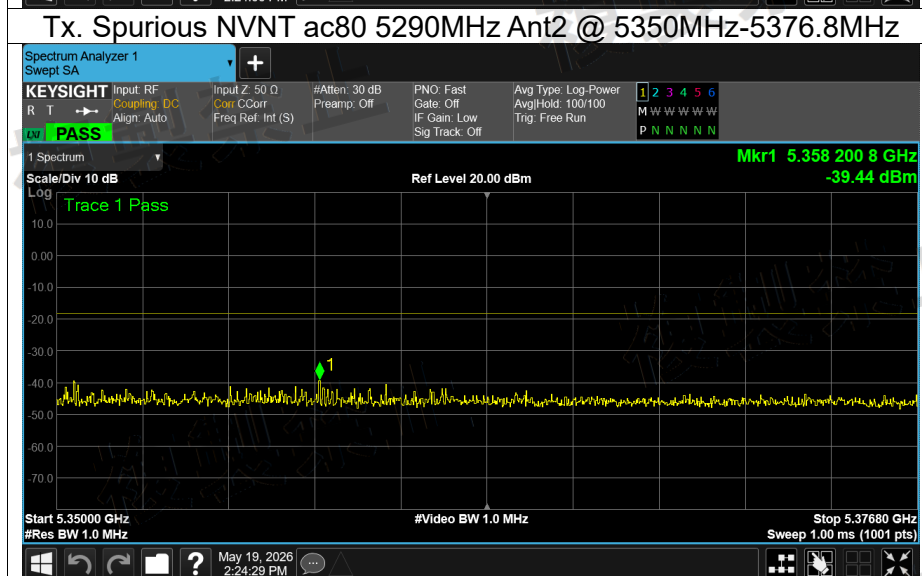
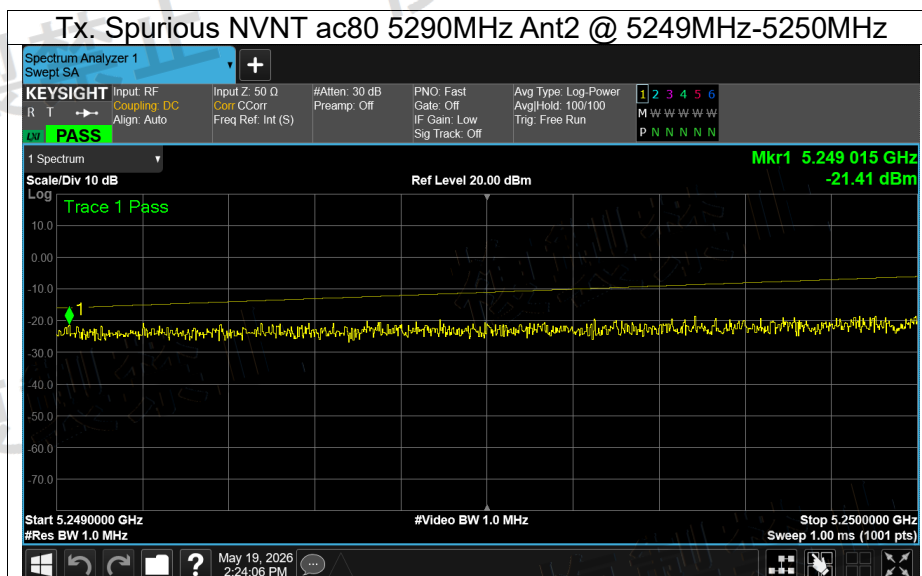


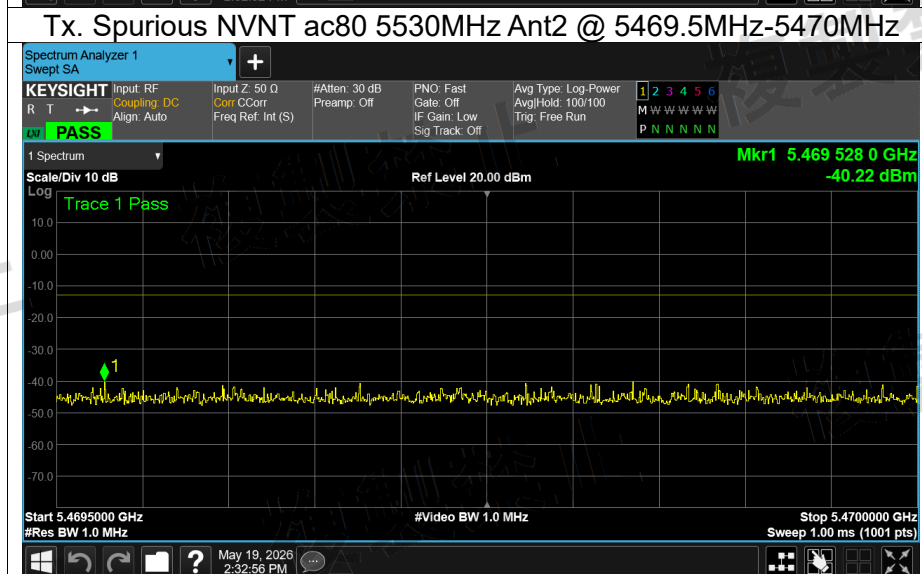
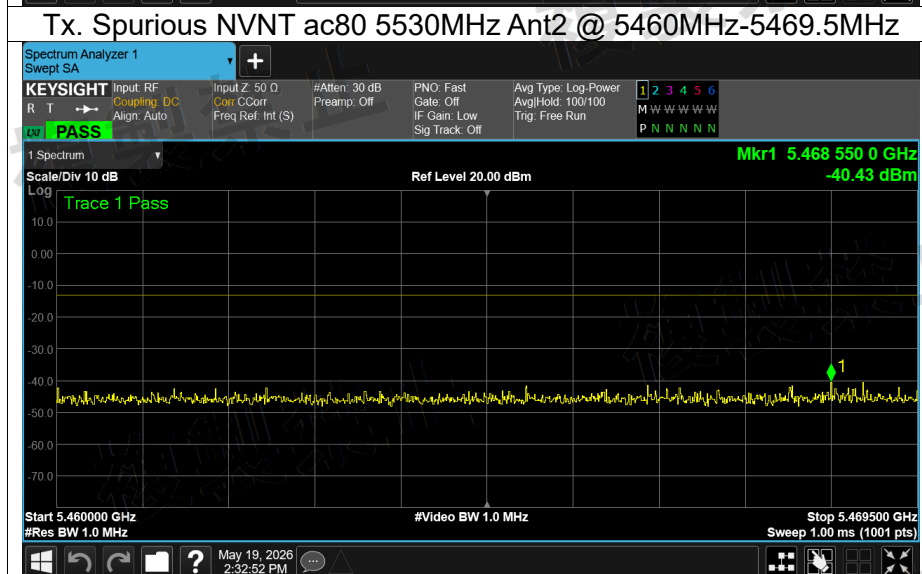
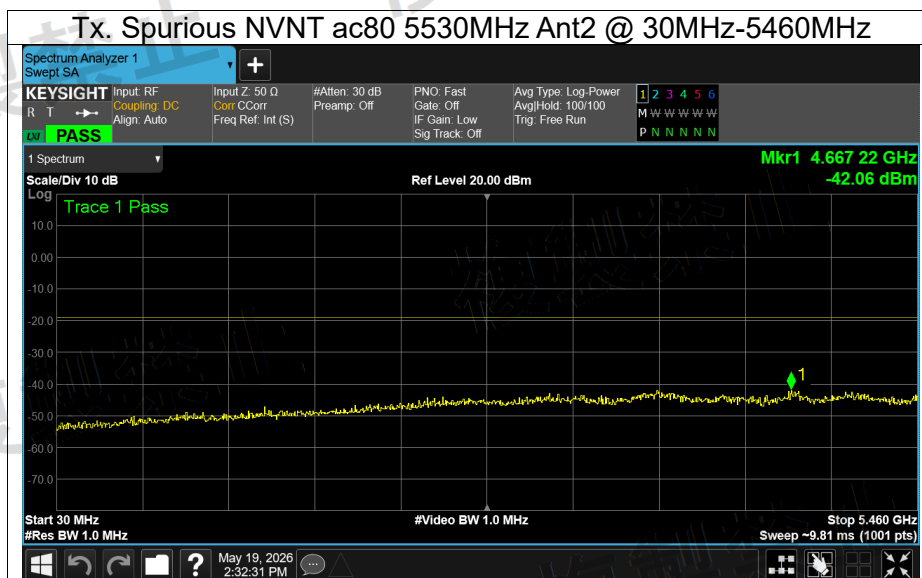


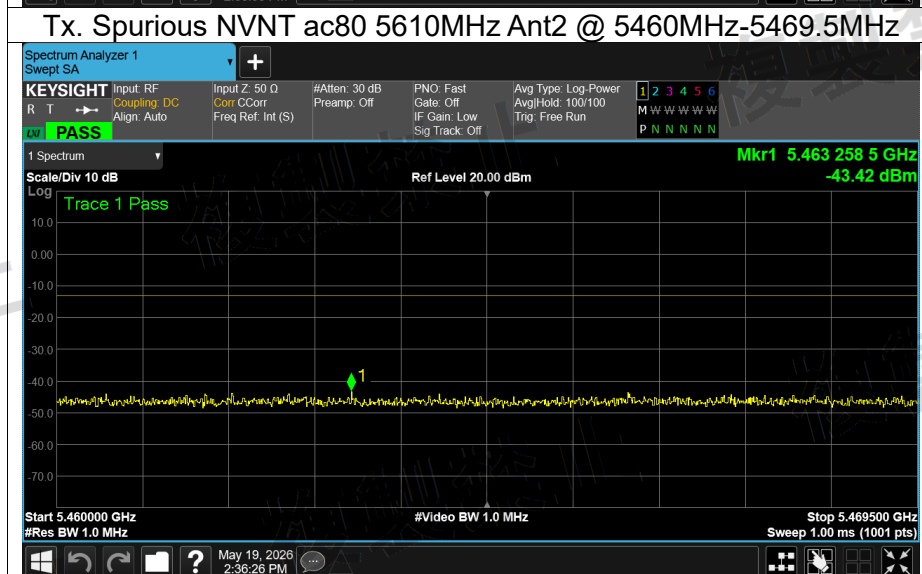
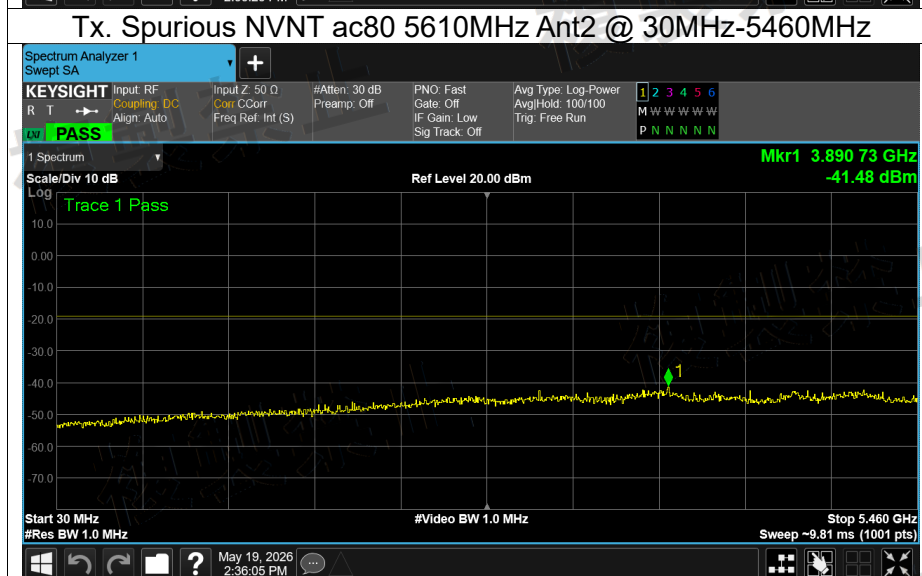
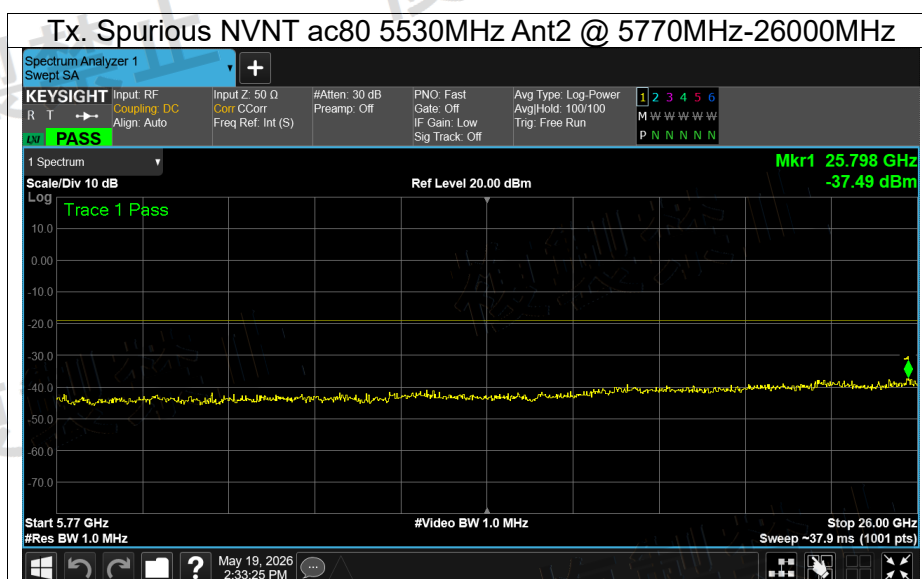


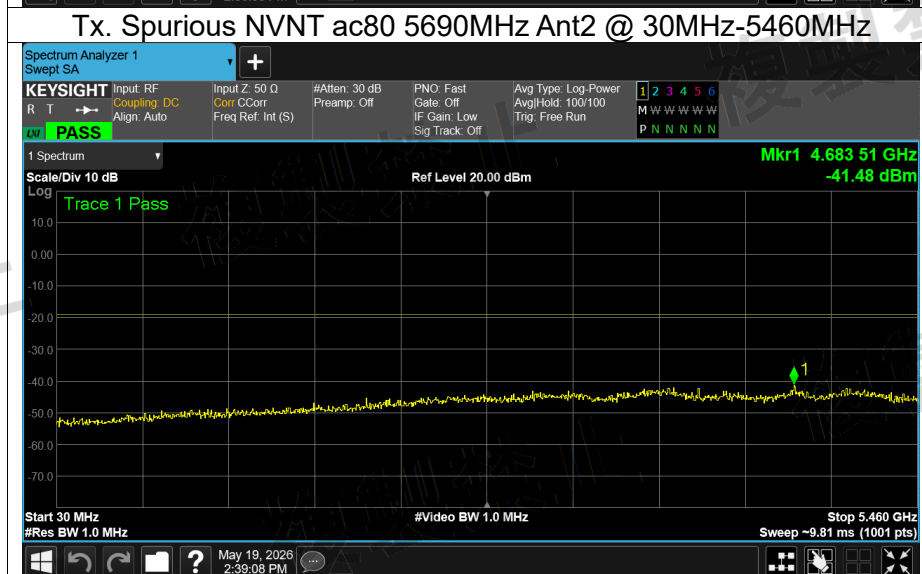
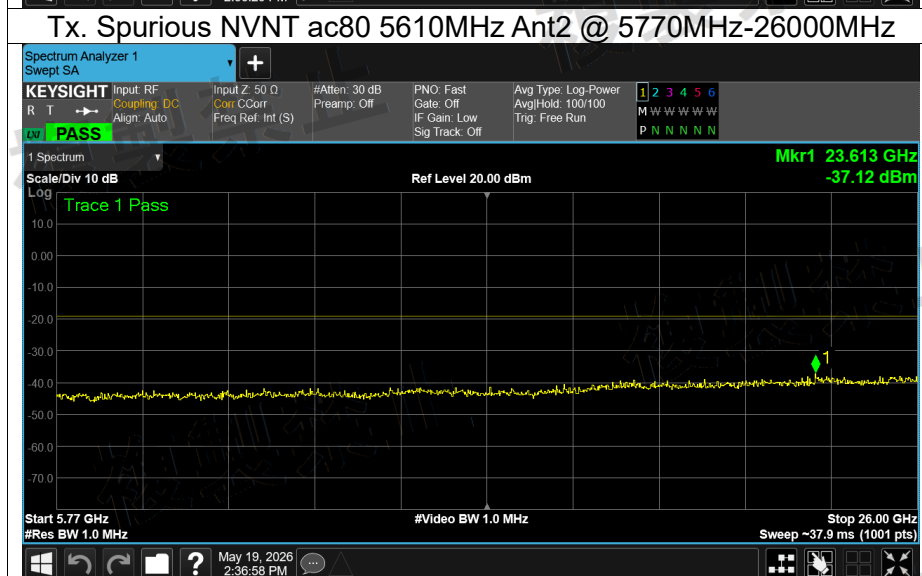
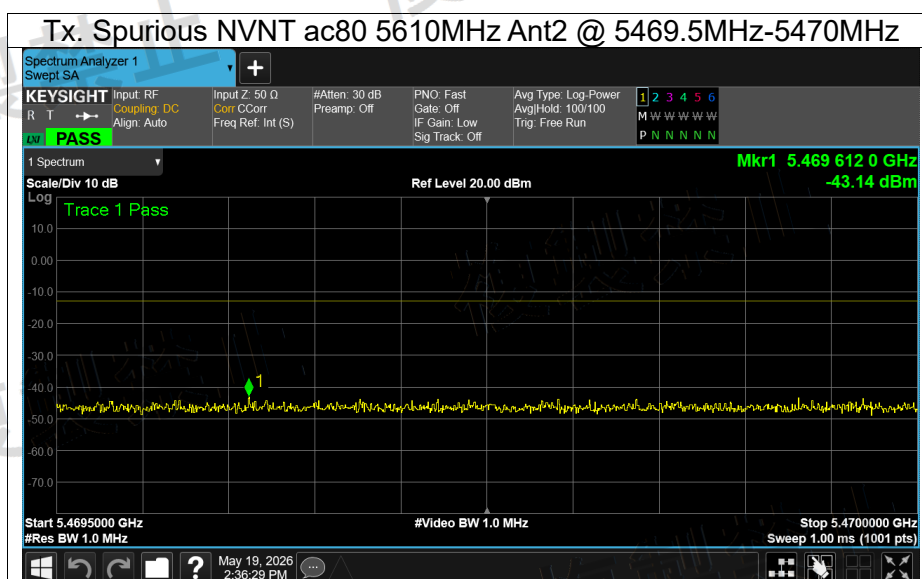


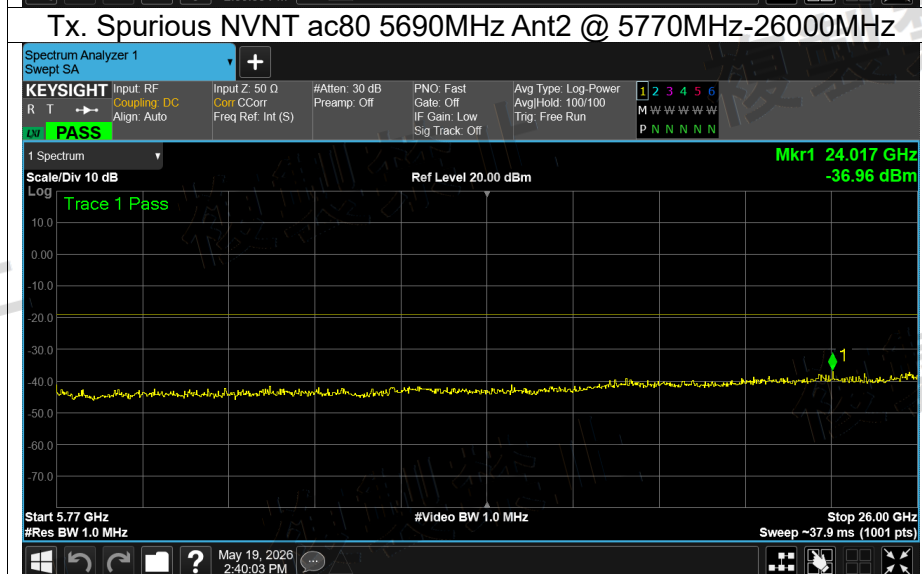
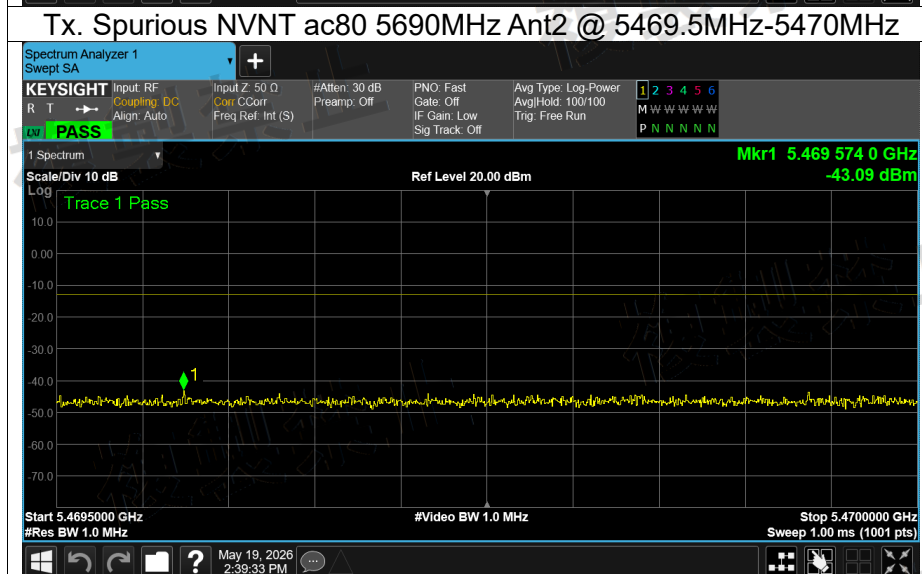
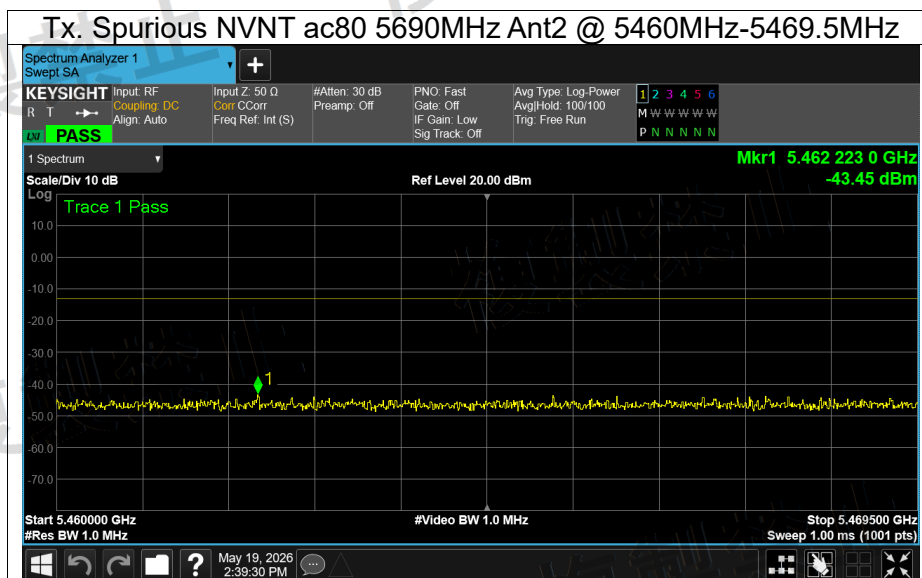


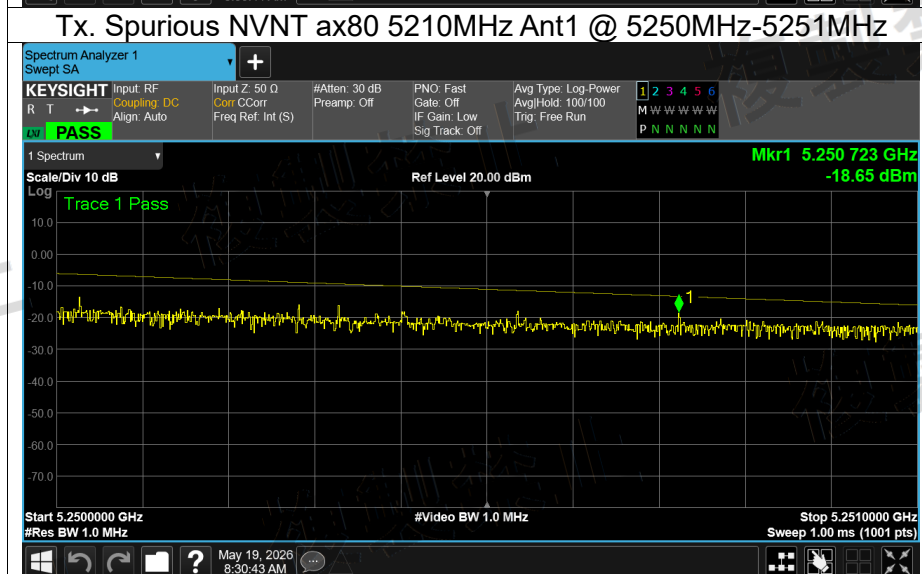
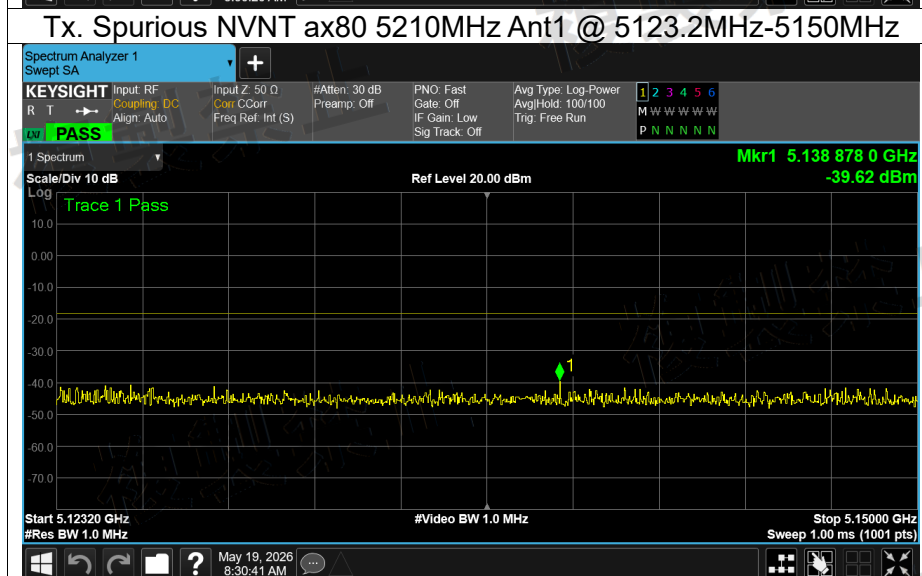
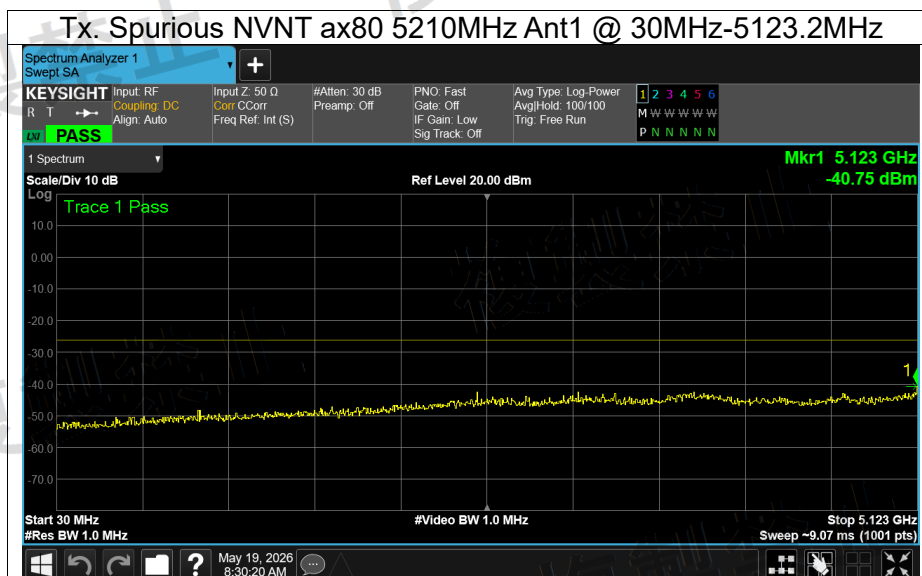


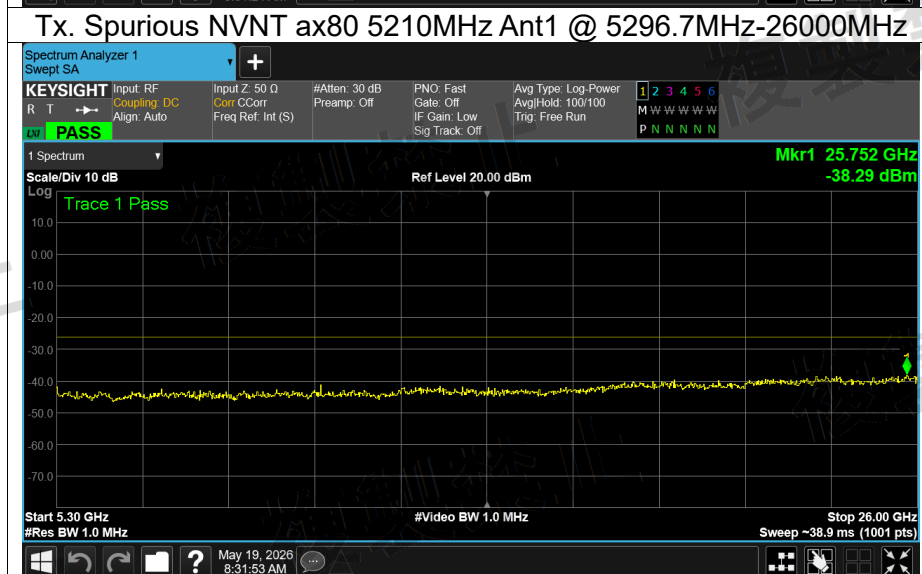
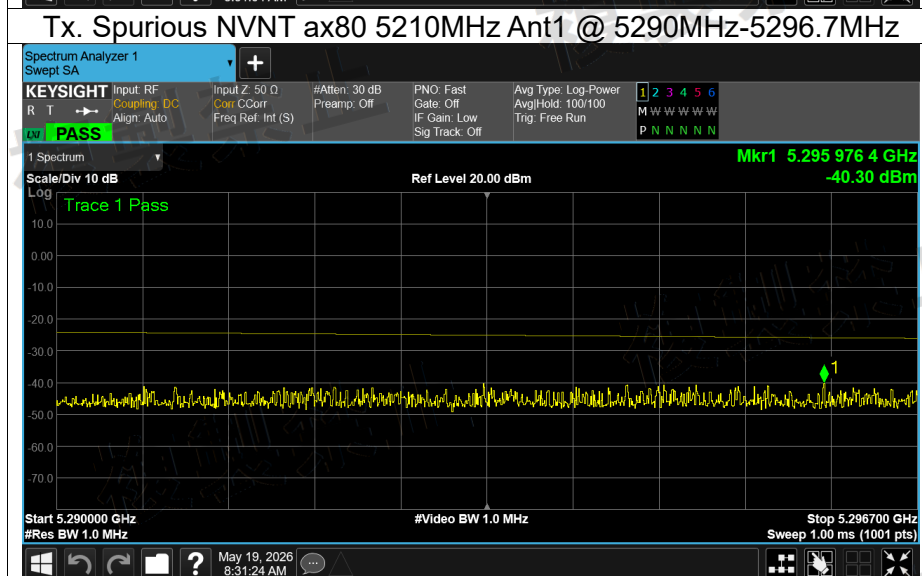
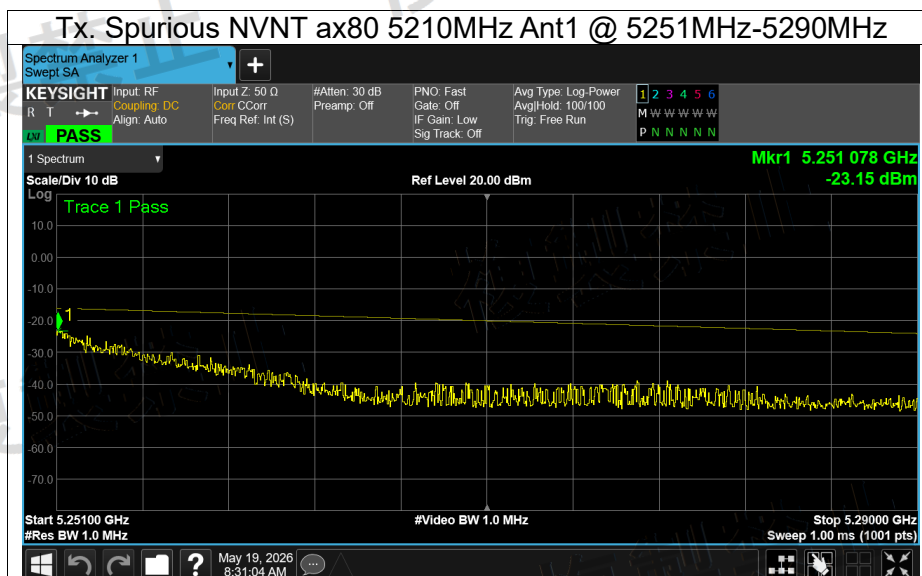


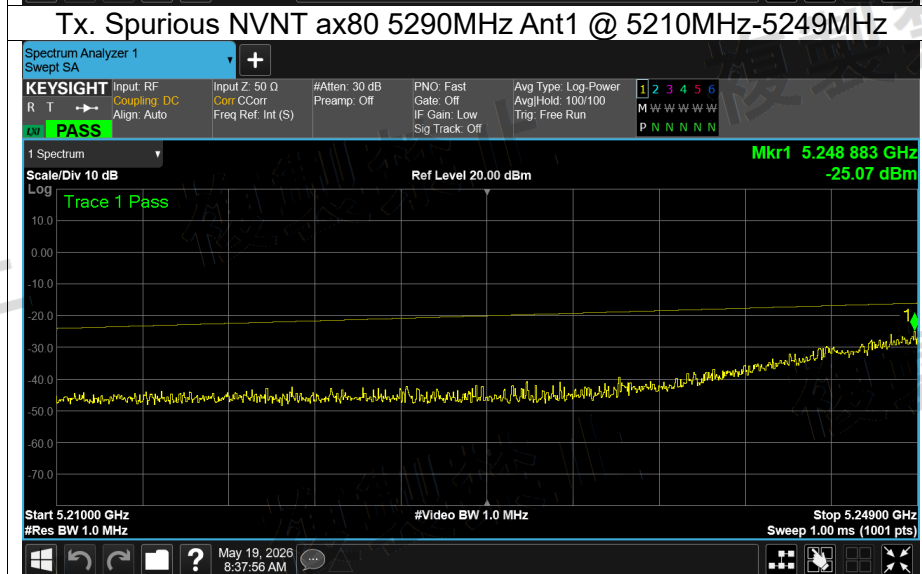
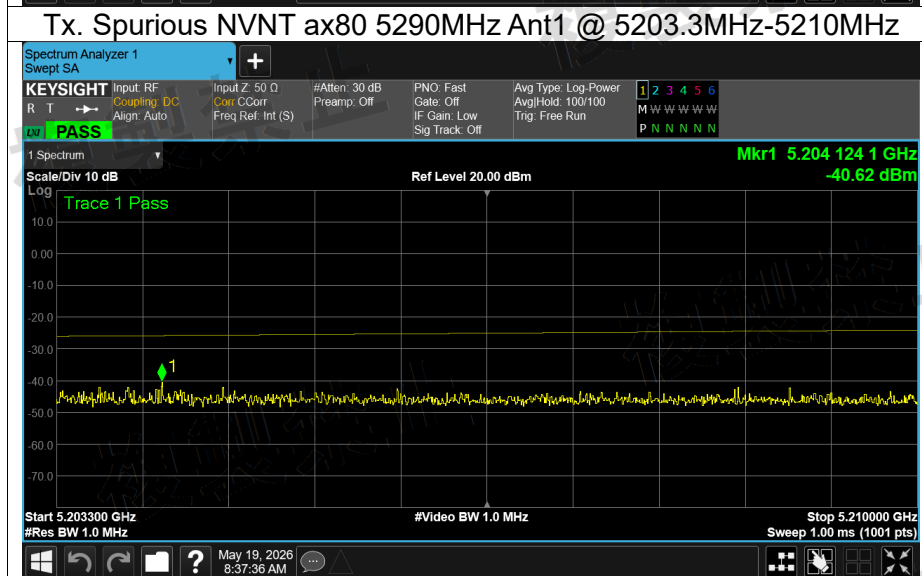
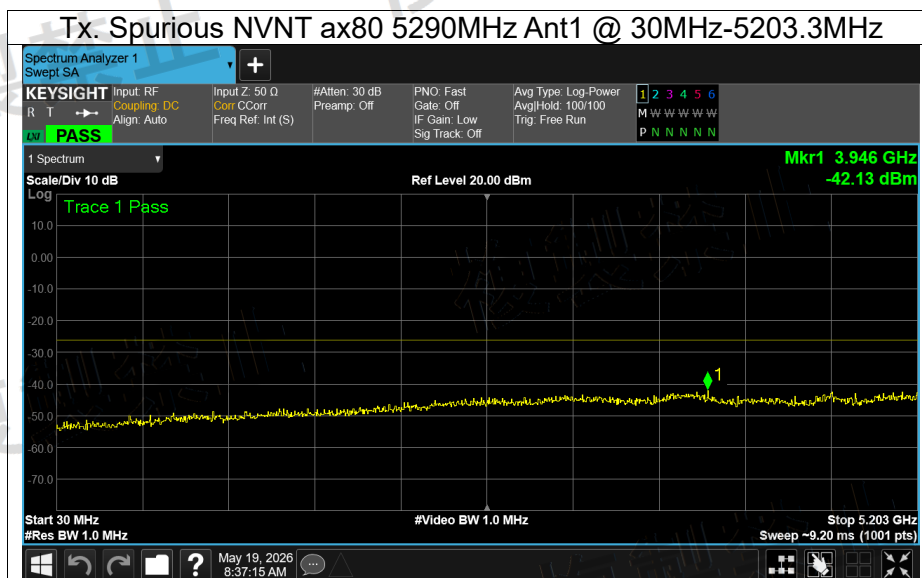


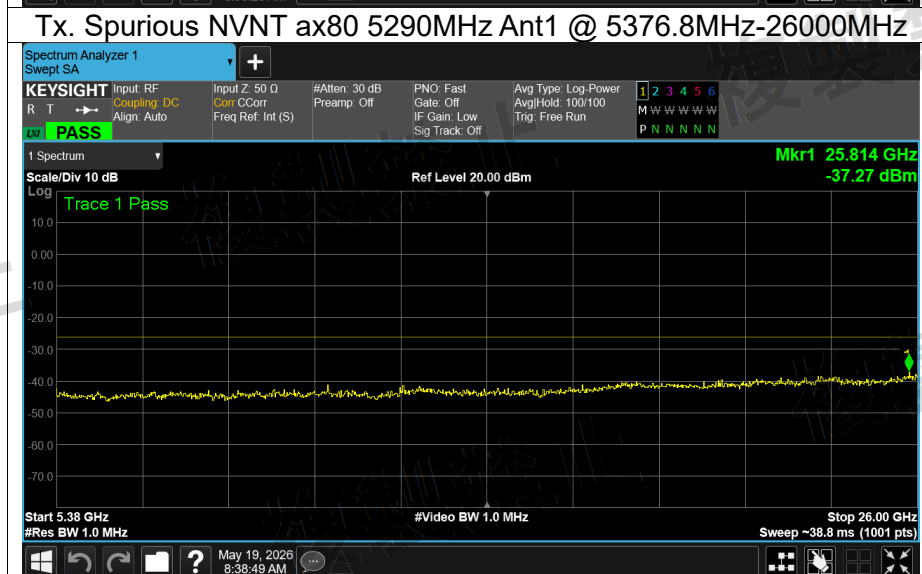
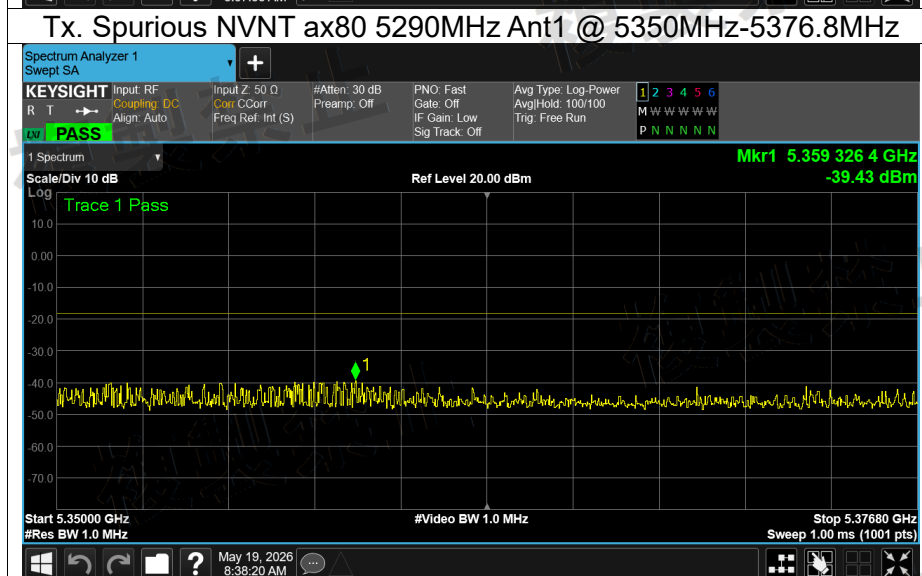
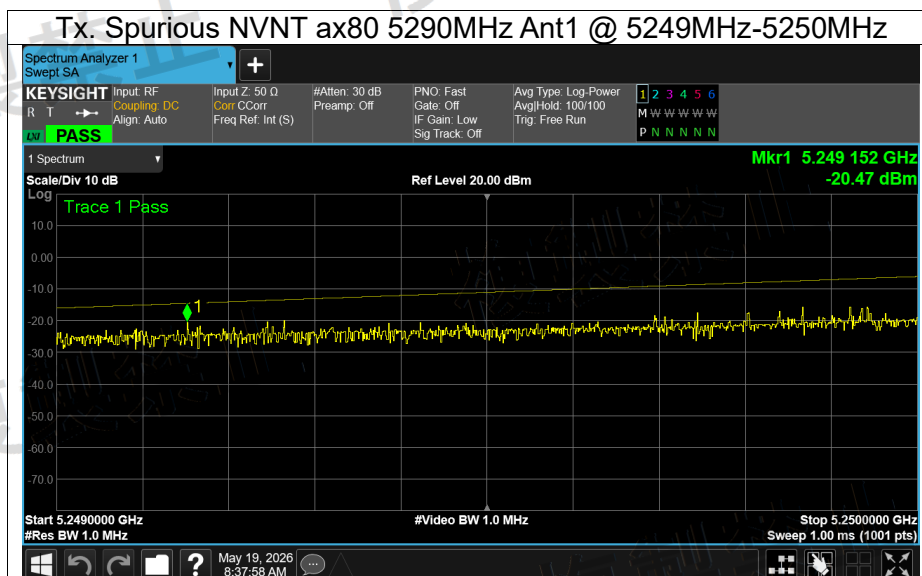


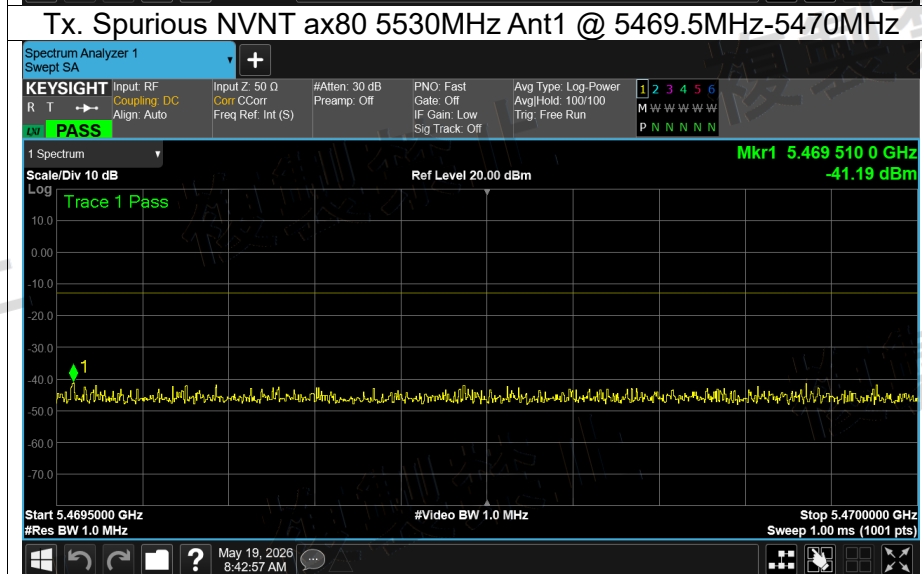
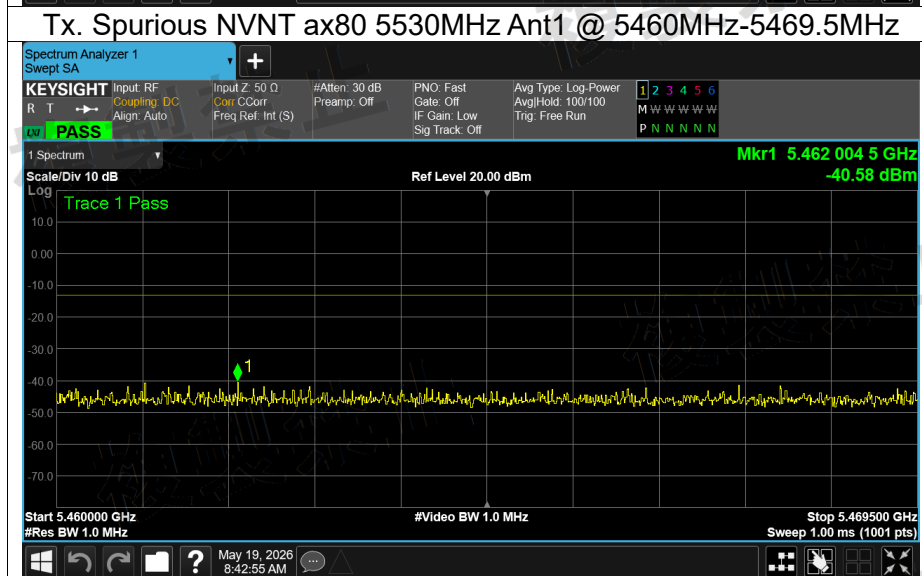
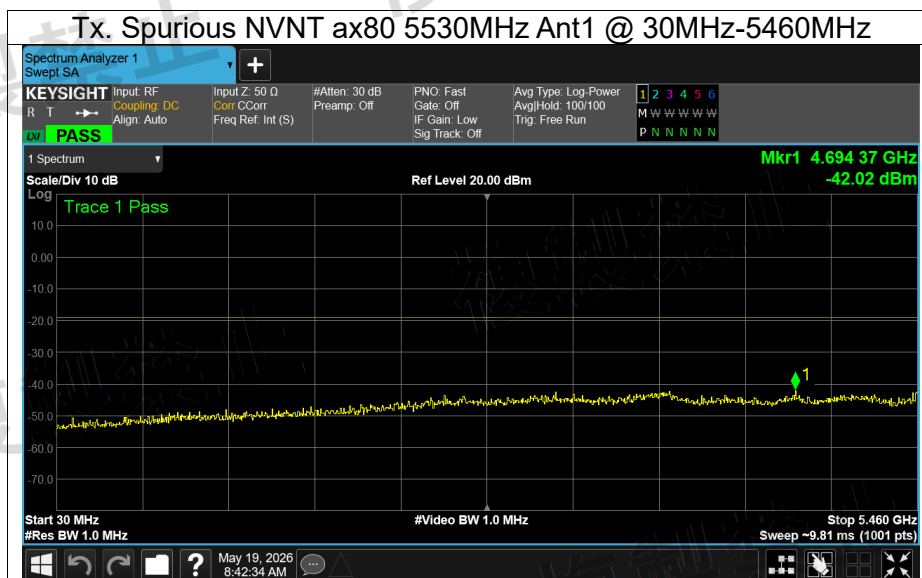


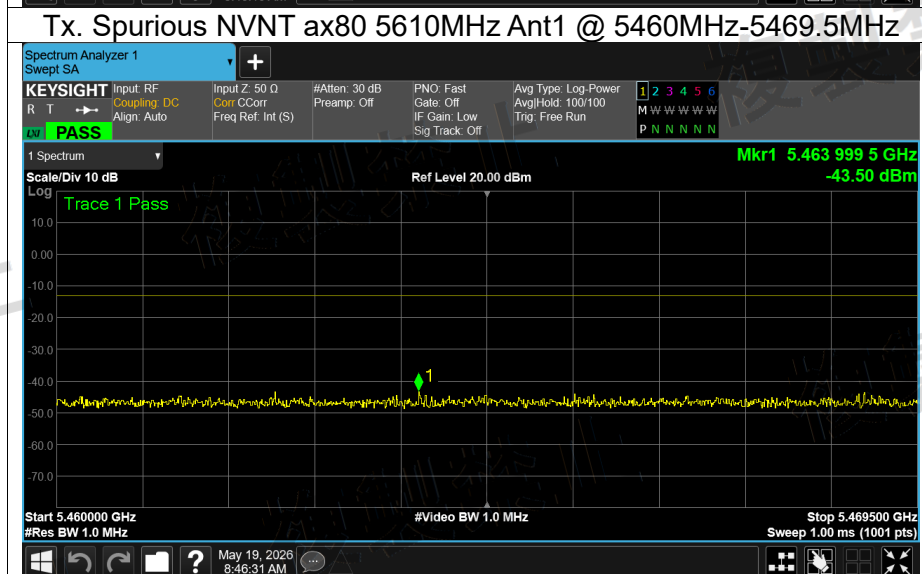
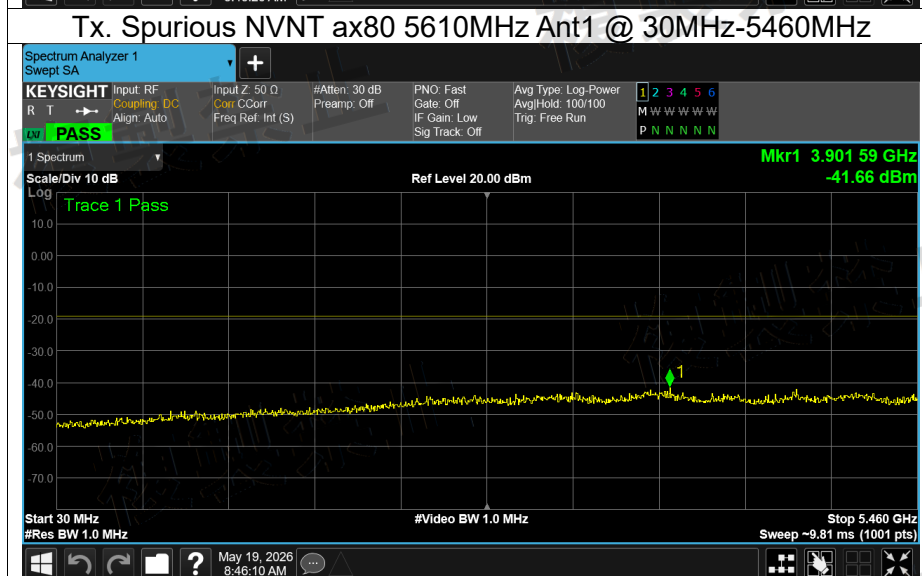
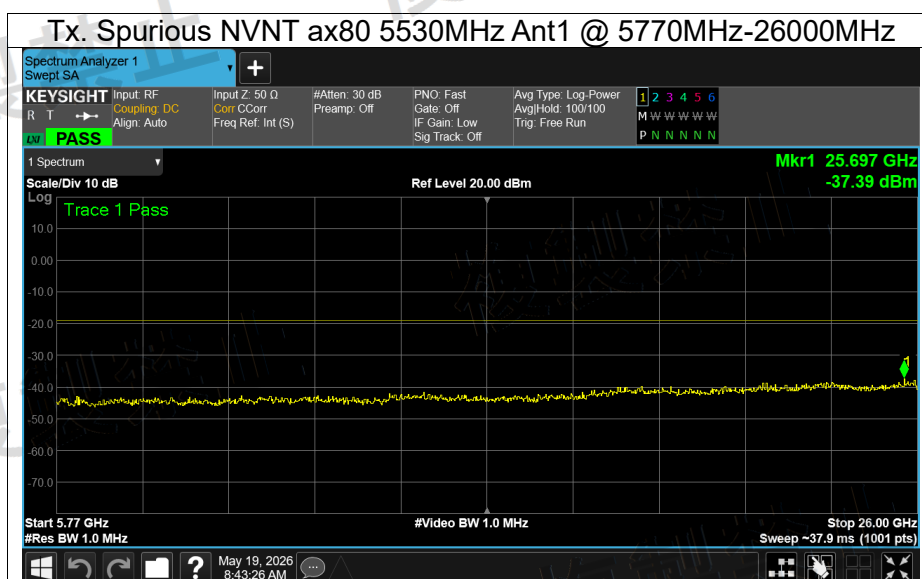


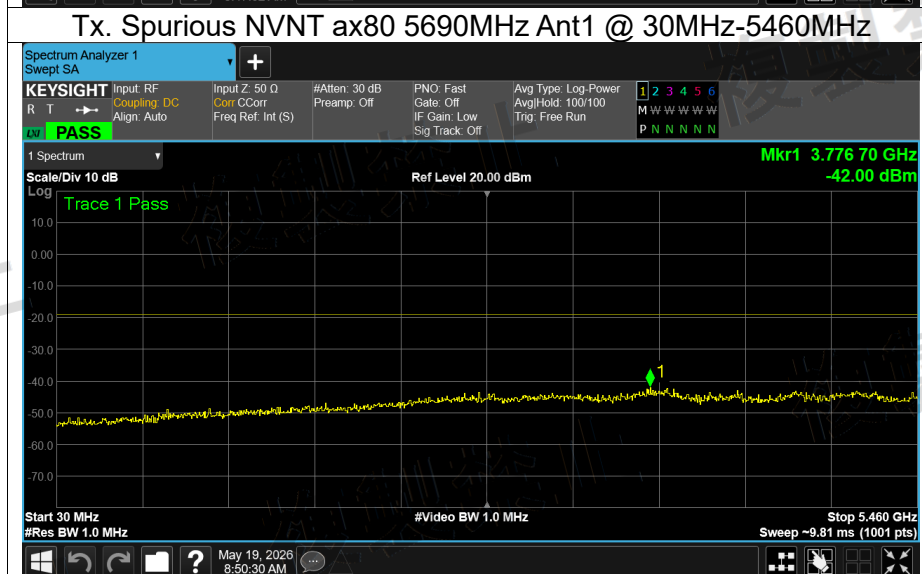
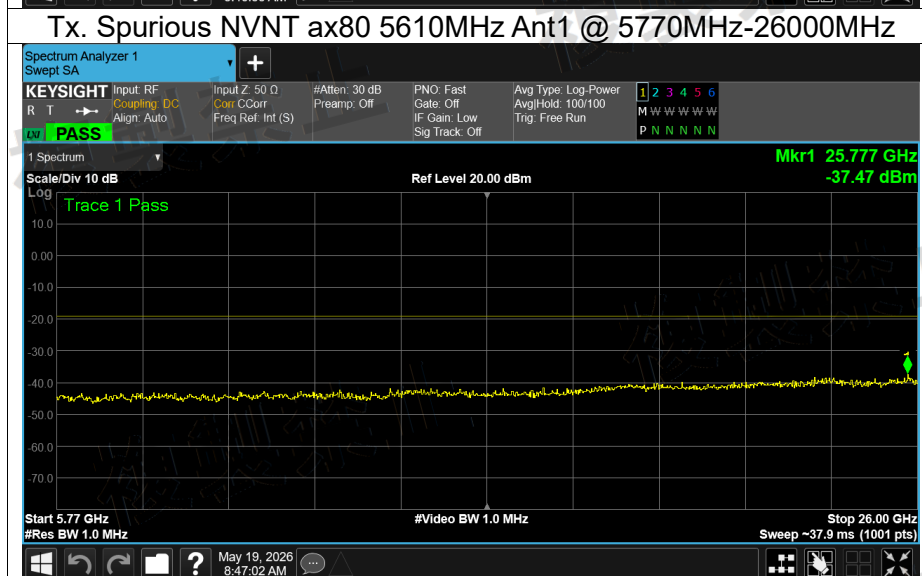
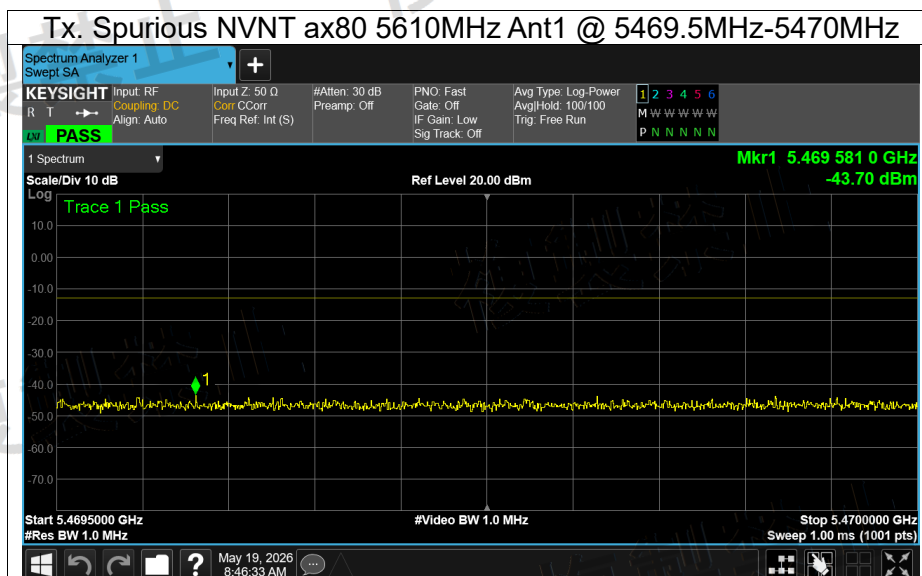


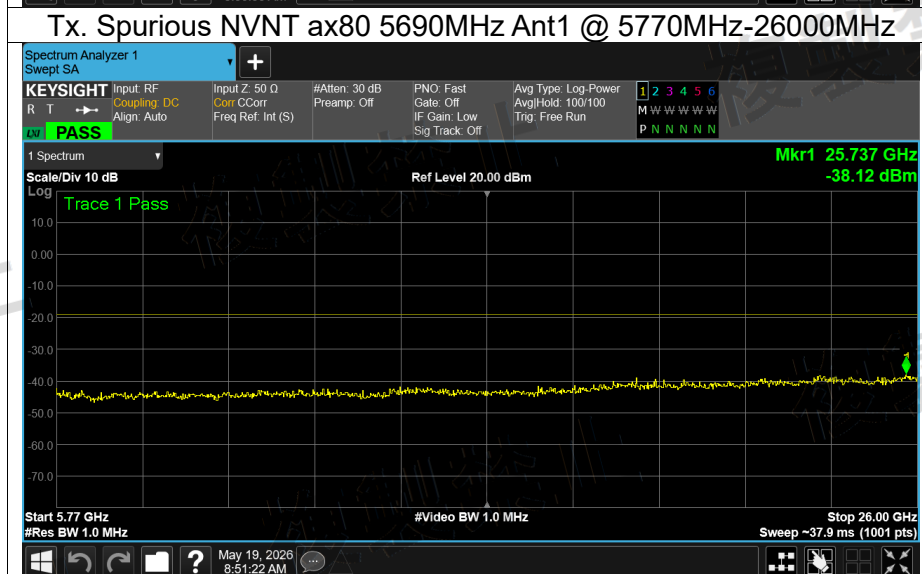
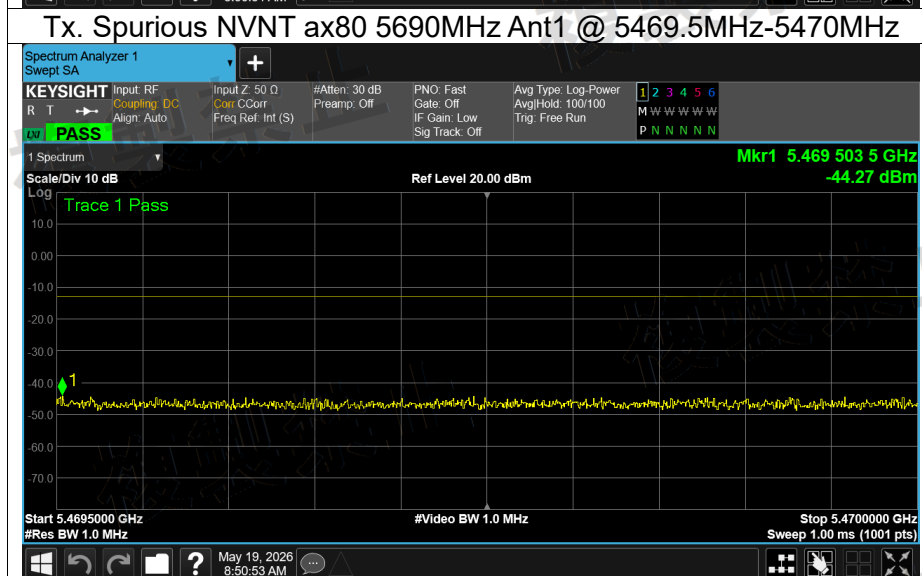
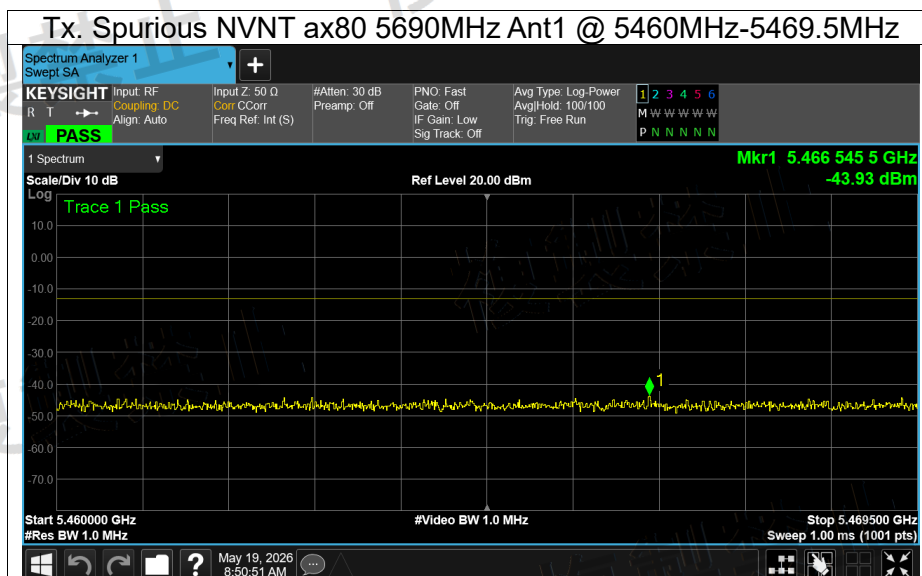


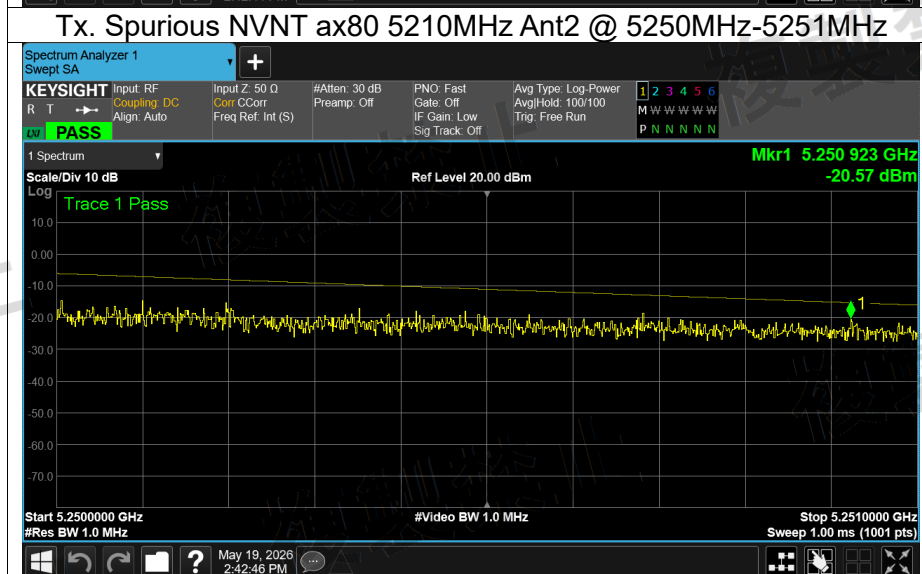
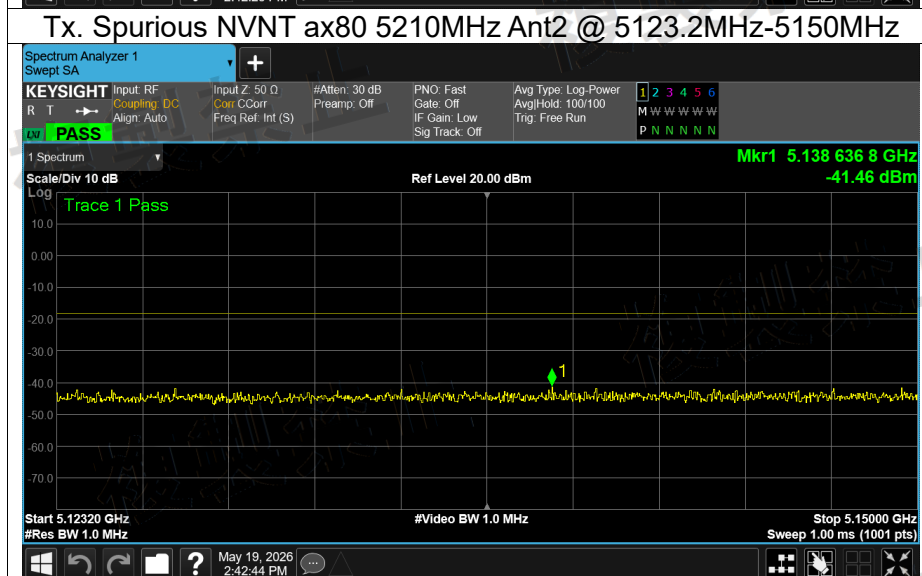
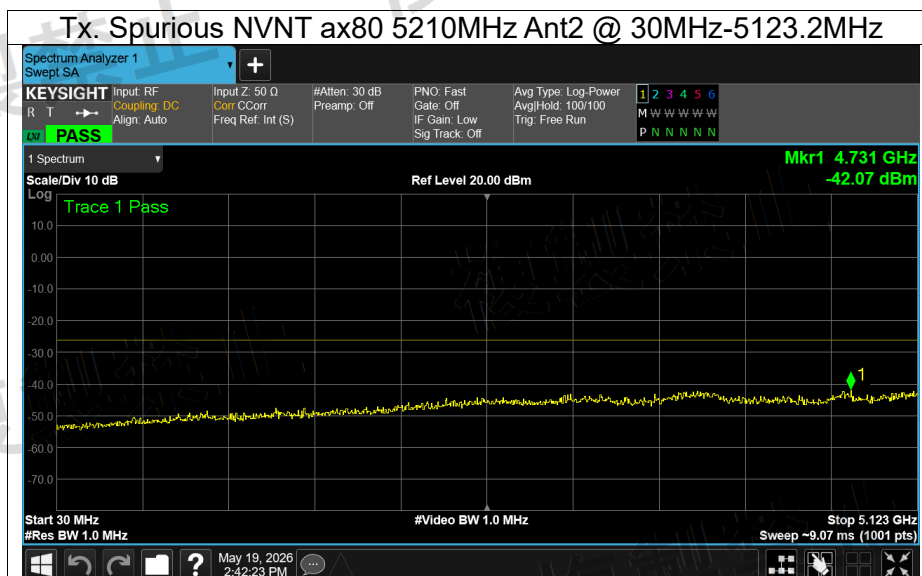


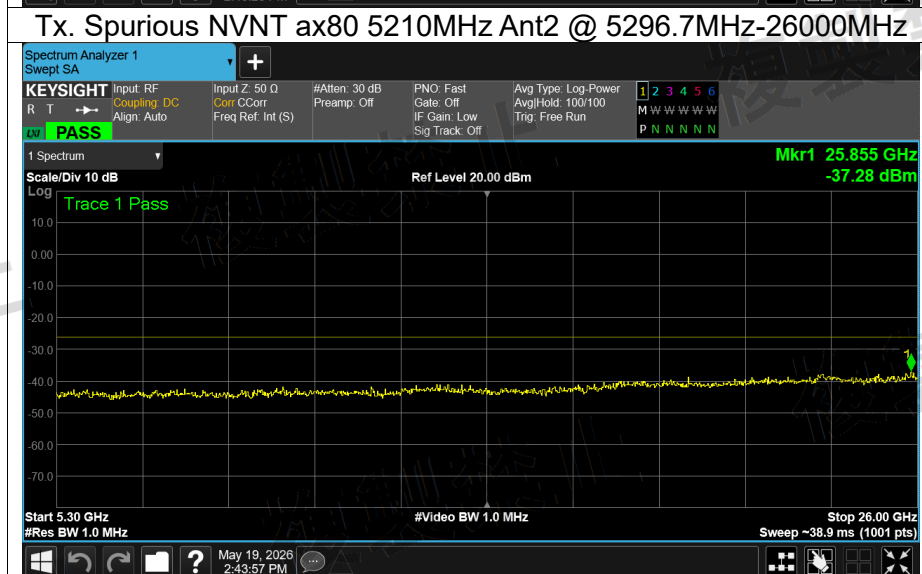
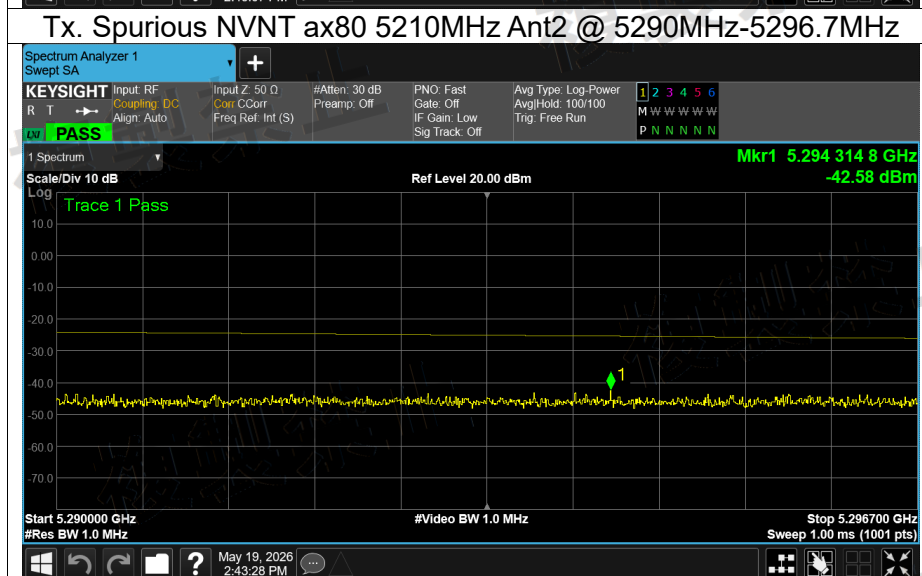
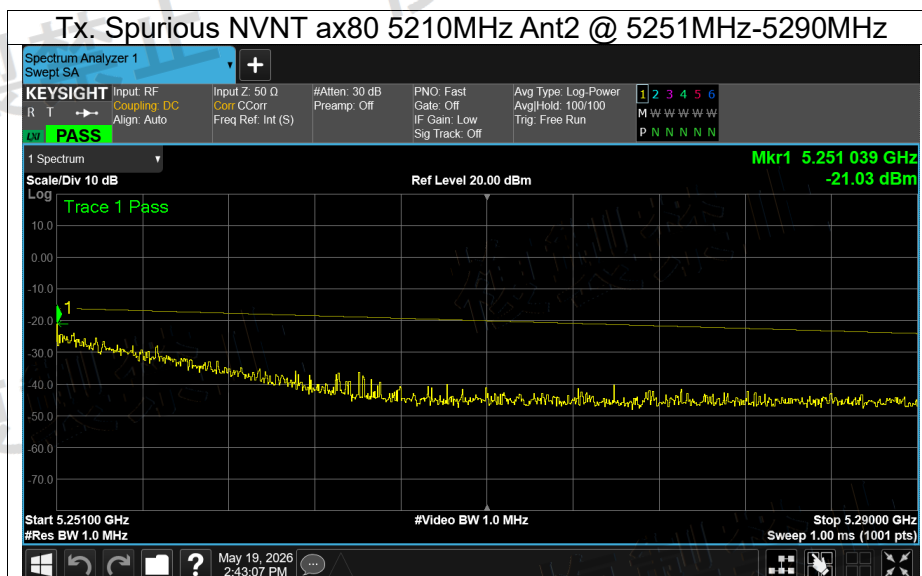


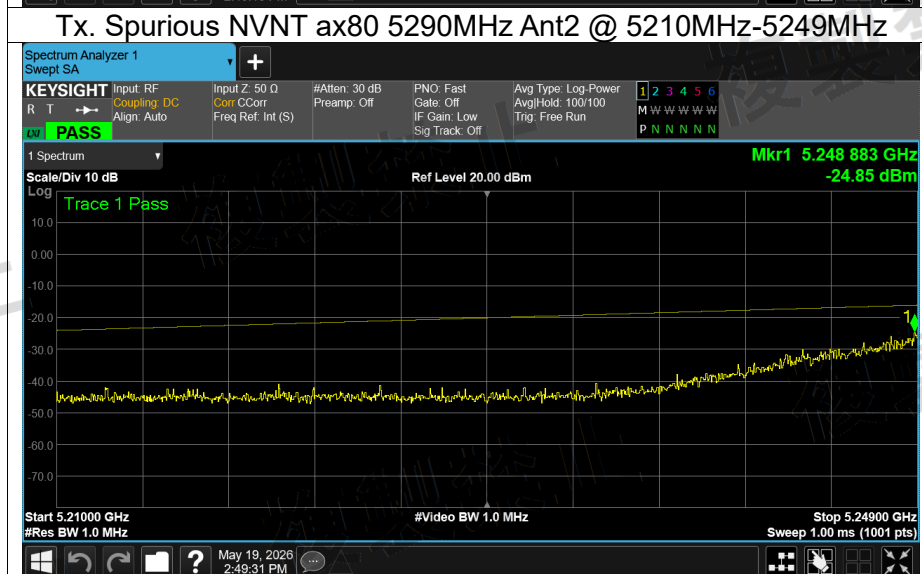
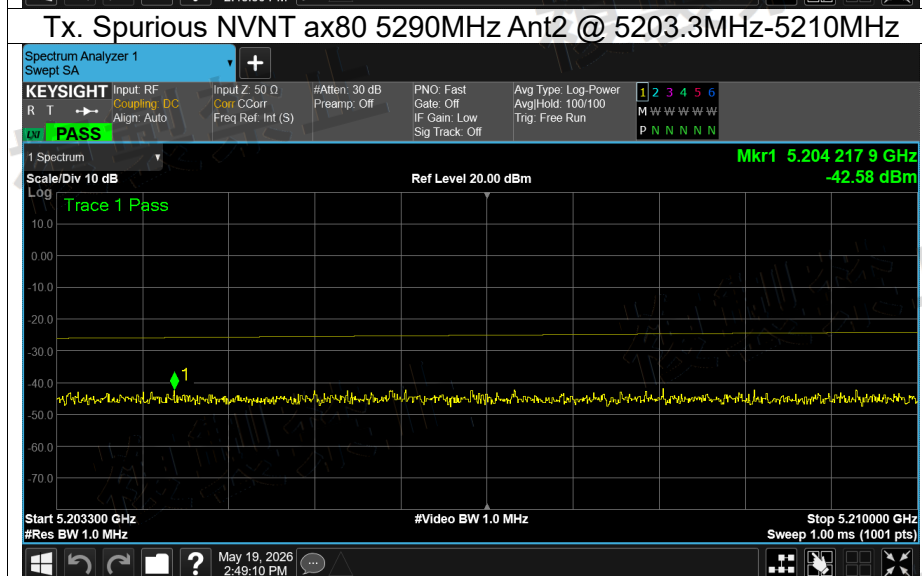
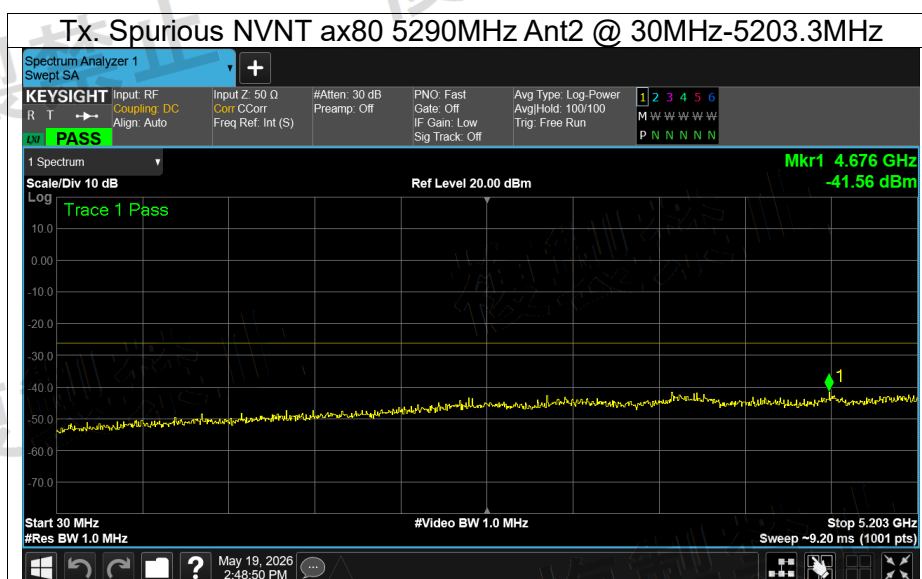


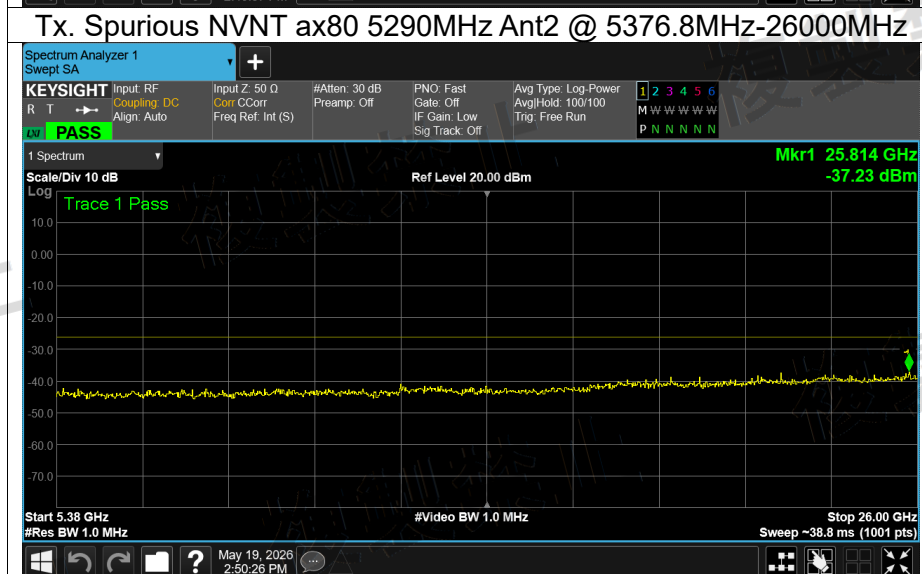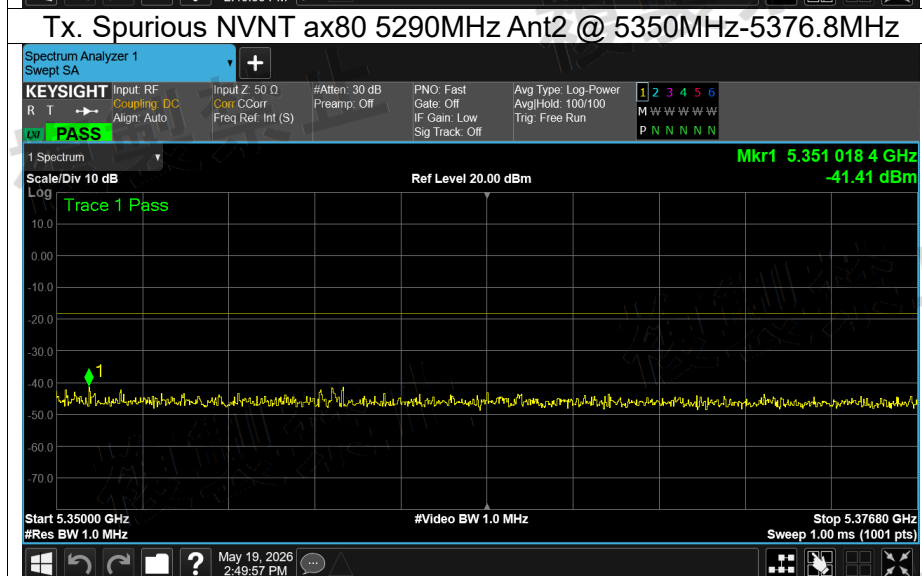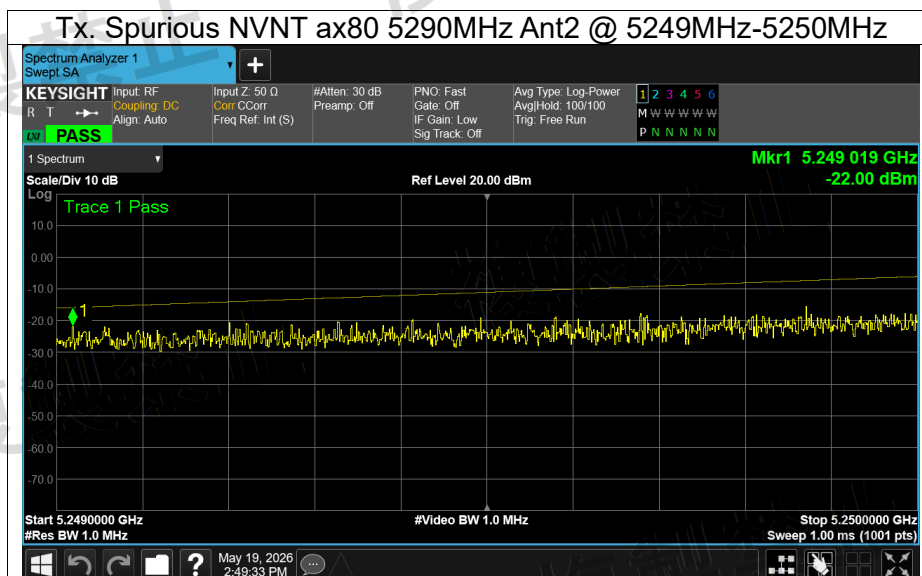

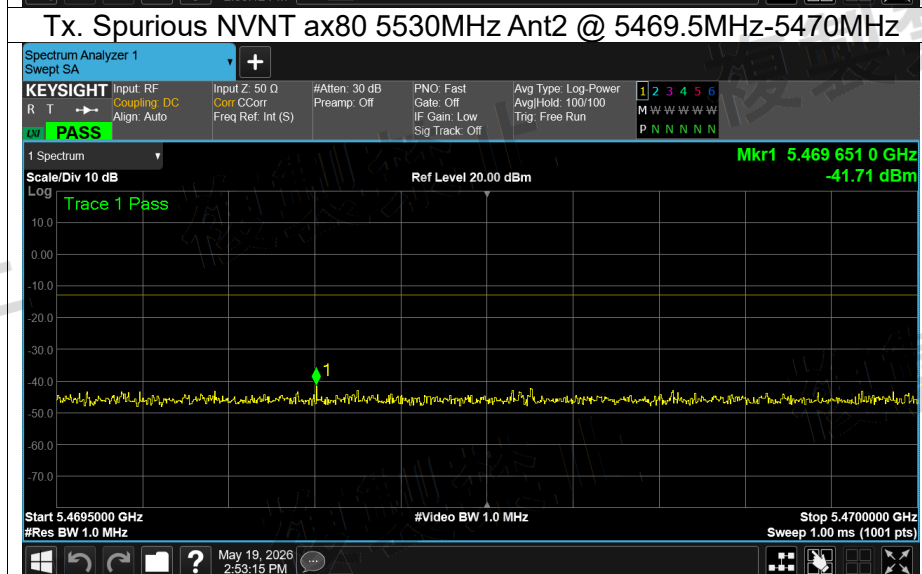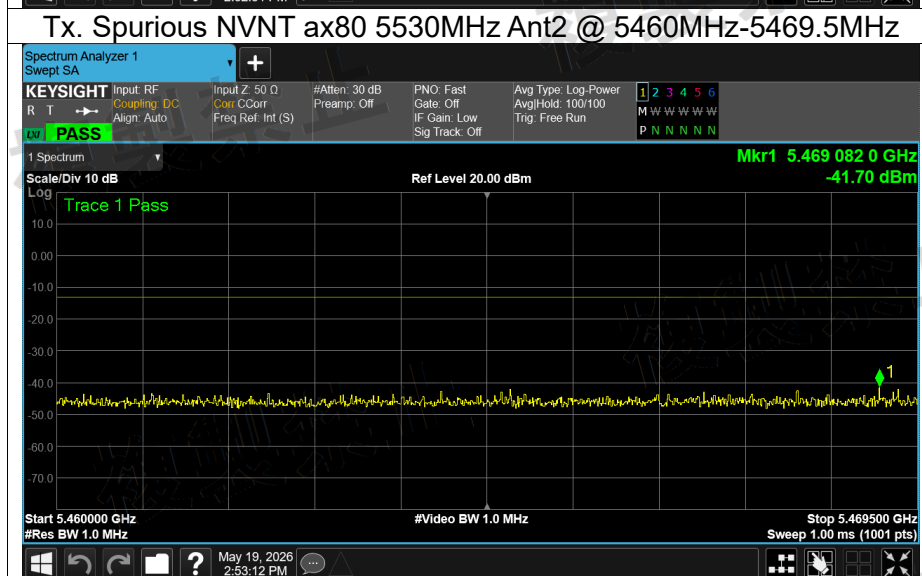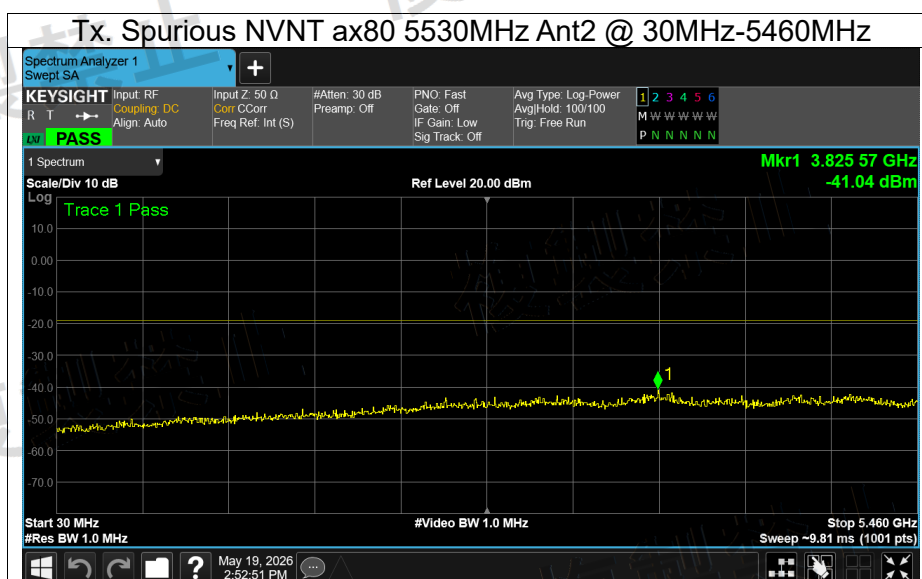

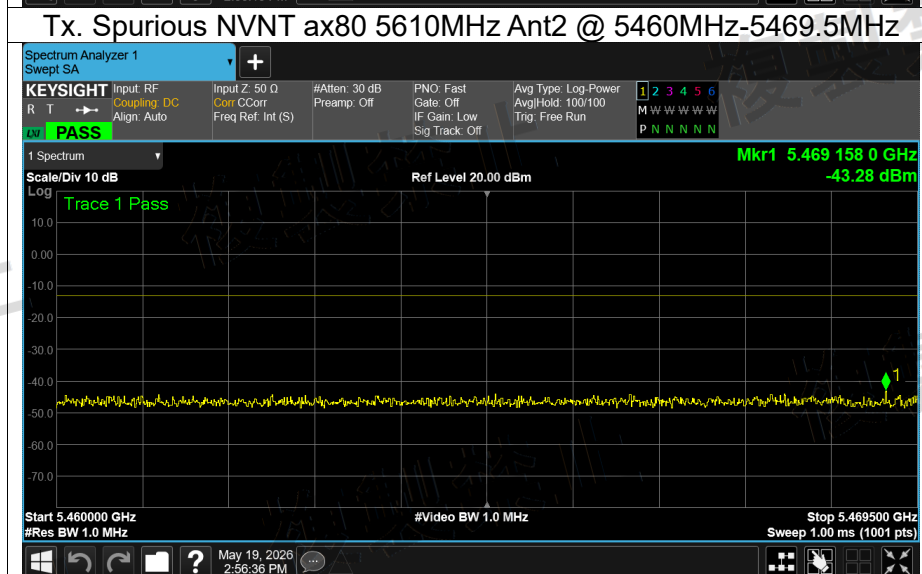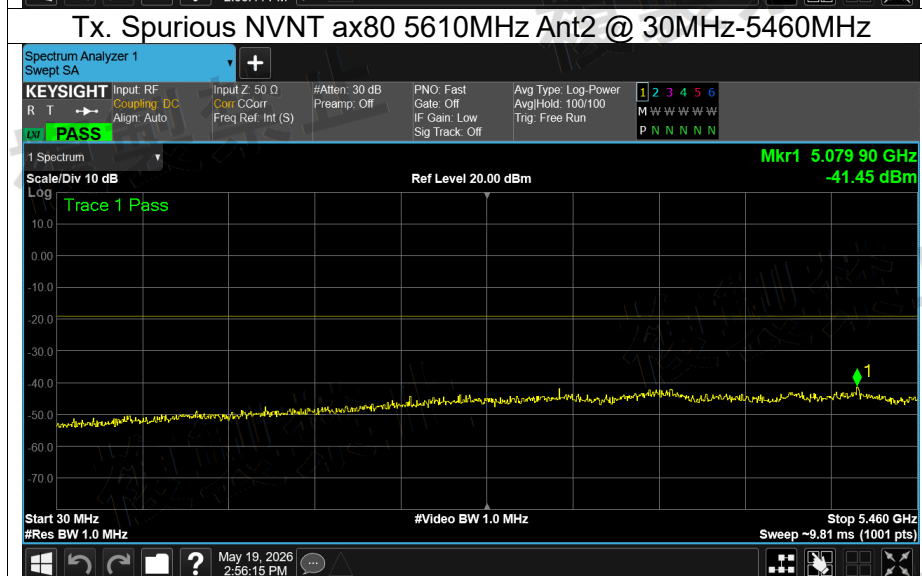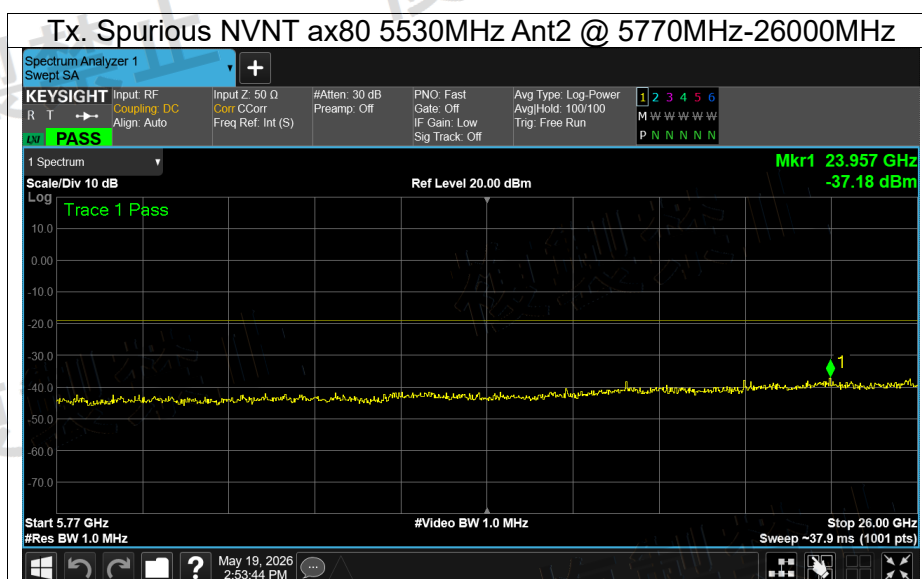

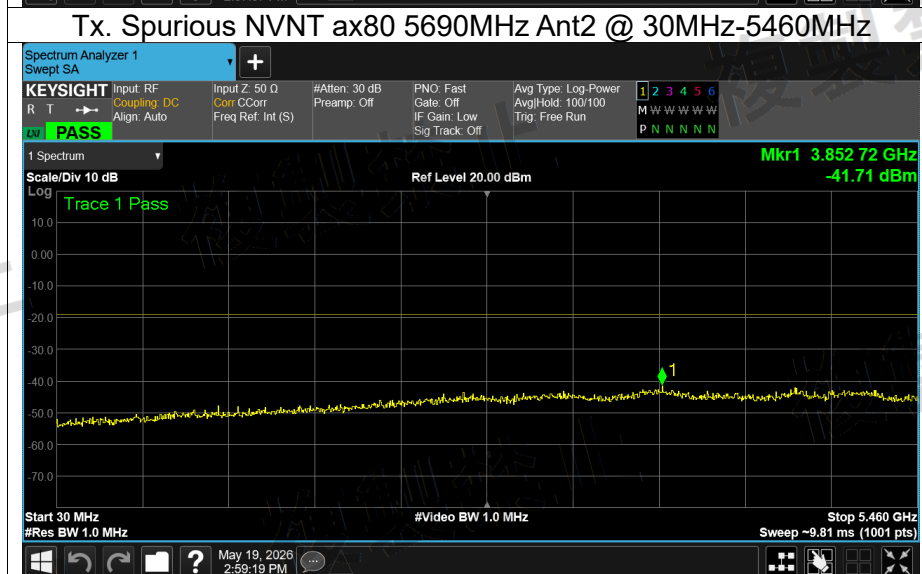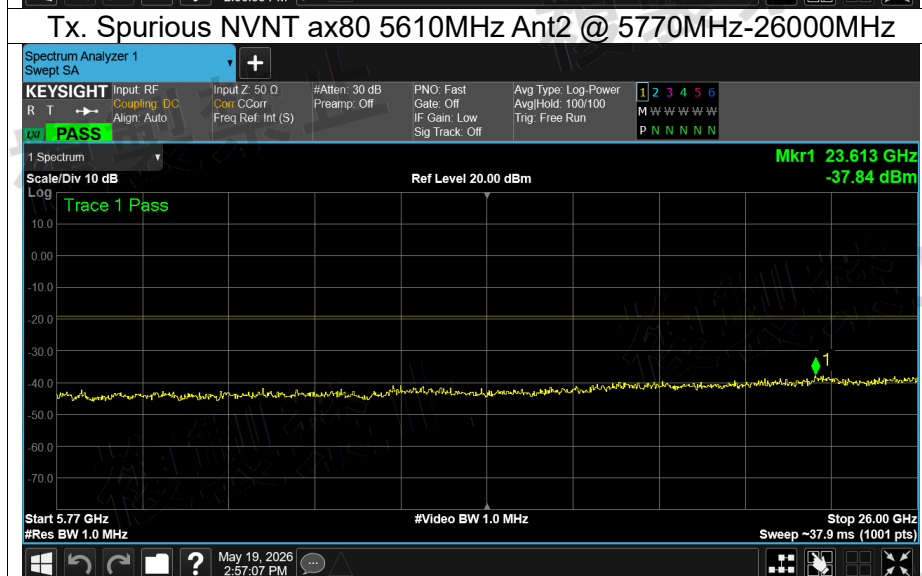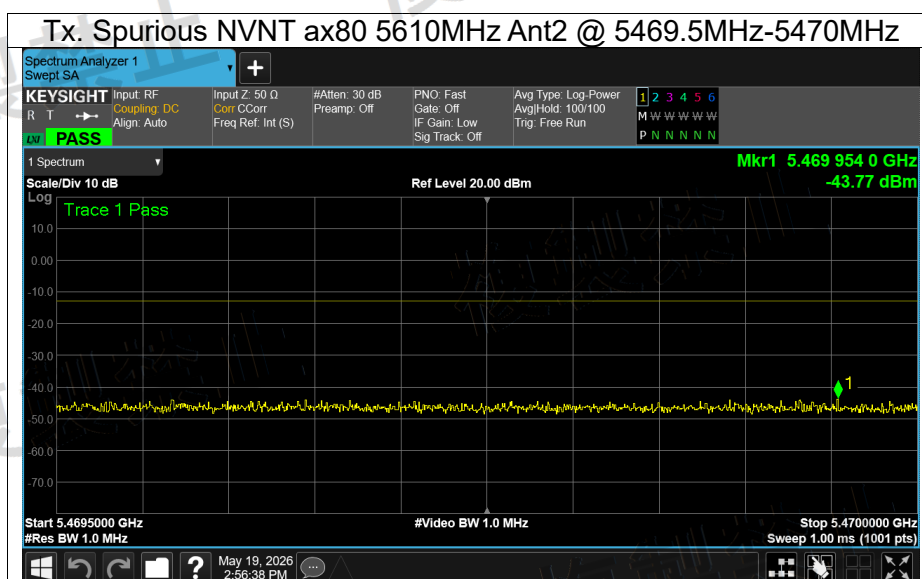

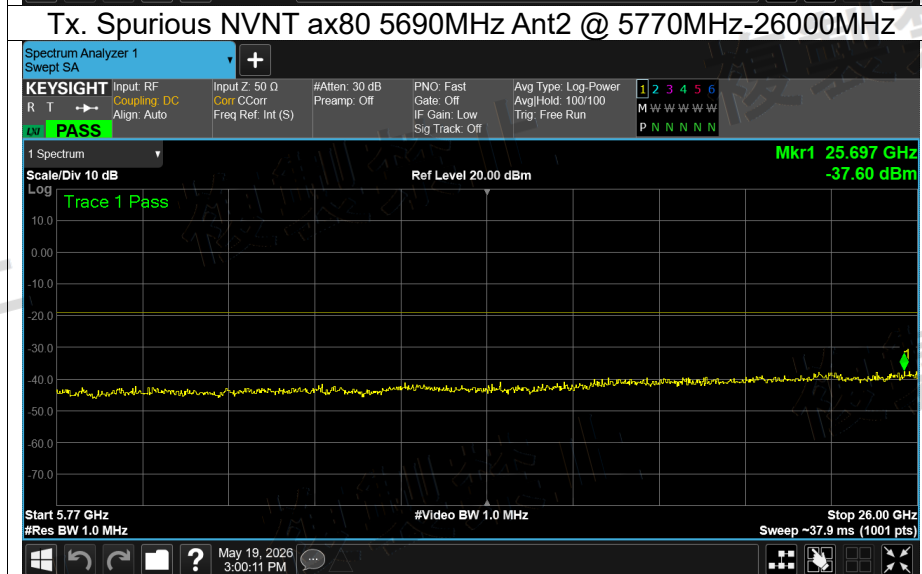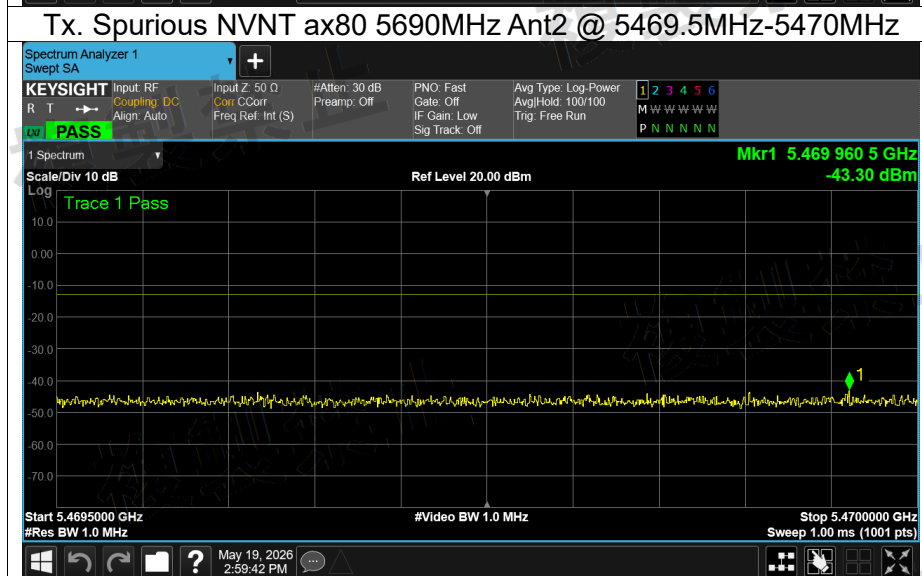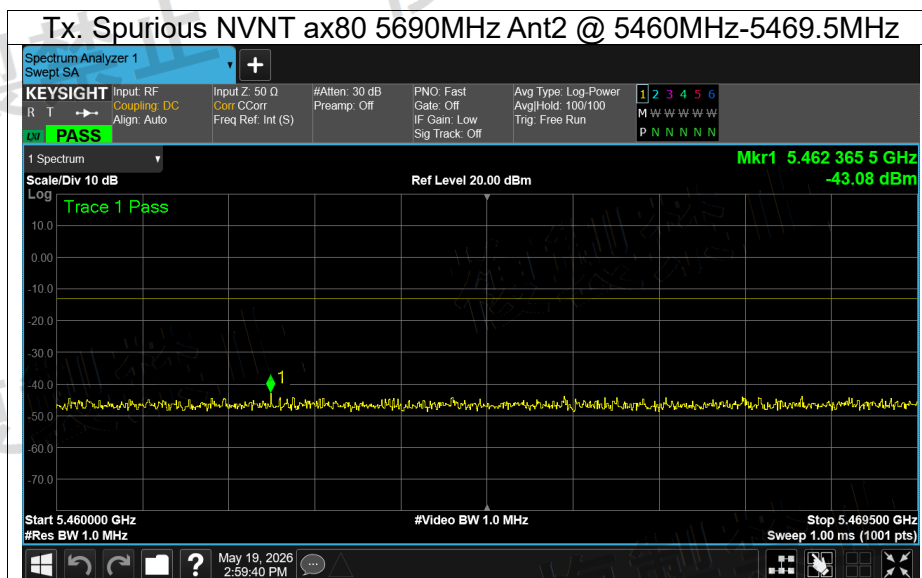









Burst Length




Condition	Mode	Frequency (MHz)	Antenna	Burst Length (ms)	Limit (ms)	Verdict
NVNT	a	Ant1	5180	0.448	8	Pass
NVNT	a	Ant1	5200	0.449	8	Pass
NVNT	a	Ant1	5240	0.449	8	Pass
NVNT	a	Ant1	5260	0.449	8	Pass
NVNT	a	Ant1	5300	0.449	8	Pass
NVNT	a	Ant1	5320	0.449	8	Pass
NVNT	a	Ant1	5500	0.449	8	Pass
NVNT	a	Ant1	5580	0.449	8	Pass
NVNT	a	Ant1	5720	0.449	8	Pass
NVNT	a	Ant2	5180	1.001	8	Pass
NVNT	a	Ant2	5200	1	8	Pass
NVNT	a	Ant2	5240	1.001	8	Pass
NVNT	a	Ant2	5260	1.001	8	Pass
NVNT	a	Ant2	5300	1.001	8	Pass
NVNT	a	Ant2	5320	1.001	8	Pass
NVNT	a	Ant2	5500	1.001	8	Pass
NVNT	a	Ant2	5580	1.001	8	Pass
NVNT	a	Ant2	5720	1.001	8	Pass
NVNT	n20	Ant1	5180	0.468	8	Pass
NVNT	n20	Ant1	5200	0.469	8	Pass
NVNT	n20	Ant1	5240	0.469	8	Pass
NVNT	n20	Ant1	5260	0.469	8	Pass
NVNT	n20	Ant1	5300	0.469	8	Pass
NVNT	n20	Ant1	5320	0.469	8	Pass
NVNT	n20	Ant1	5500	0.469	8	Pass
NVNT	n20	Ant1	5580	0.469	8	Pass
NVNT	n20	Ant1	5720	0.469	8	Pass
NVNT	n20	Ant2	5180	1.021	8	Pass
NVNT	n20	Ant2	5200	1.02	8	Pass
NVNT	n20	Ant2	5240	1.02	8	Pass
NVNT	n20	Ant2	5260	1.021	8	Pass
NVNT	n20	Ant2	5300	1.021	8	Pass
NVNT	n20	Ant2	5320	1.021	8	Pass
NVNT	n20	Ant2	5500	1.02	8	Pass
NVNT	n20	Ant2	5580	1.021	8	Pass
NVNT	n20	Ant2	5720	1.021	8	Pass
NVNT	n40	Ant1	5190	0.181	8	Pass
NVNT	n40	Ant1	5230	0.181	8	Pass
NVNT	n40	Ant1	5270	0.18	8	Pass
NVNT	n40	Ant1	5310	0.181	8	Pass
NVNT	n40	Ant1	5510	0.181	8	Pass
NVNT	n40	Ant1	5550	0.18	8	Pass
NVNT	n40	Ant1	5710	0.181	8	Pass
NVNT	n40	Ant2	5190	0.492	8	Pass
NVNT	n40	Ant2	5230	0.493	8	Pass
NVNT	n40	Ant2	5270	0.493	8	Pass
NVNT	n40	Ant2	5310	0.493	8	Pass
NVNT	n40	Ant2	5510	0.493	8	Pass
NVNT	n40	Ant2	5550	0.492	8	Pass
NVNT	n40	Ant2	5710	0.493	8	Pass
NVNT	ac80	Ant1	5210	0.164	8	Pass
NVNT	ac80	Ant1	5290	0.164	8	Pass
NVNT	ac80	Ant1	5530	0.165	8	Pass
NVNT	ac80	Ant1	5610	0.165	8	Pass









NVNT	ac80	Ant1	5690	0.165	8	Pass
NVNT	ac80	Ant2	5210	0.48	8	Pass
NVNT	ac80	Ant2	5290	0.48	8	Pass
NVNT	ac80	Ant2	5530	0.481	8	Pass
NVNT	ac80	Ant2	5610	0.481	8	Pass
NVNT	ac80	Ant2	5690	0.481	8	Pass
NVNT	ax80	Ant1	5210	0.163	8	Pass
NVNT	ax80	Ant1	5290	0.163	8	Pass
NVNT	ax80	Ant1	5530	0.163	8	Pass
NVNT	ax80	Ant1	5610	0.163	8	Pass
NVNT	ax80	Ant1	5690	0.163	8	Pass
NVNT	ax80	Ant2	5210	0.476	8	Pass
NVNT	ax80	Ant2	5290	0.476	8	Pass
NVNT	ax80	Ant2	5530	0.476	8	Pass
NVNT	ax80	Ant2	5610	0.476	8	Pass
NVNT	ax80	Ant2	5690	0.476	8	Pass

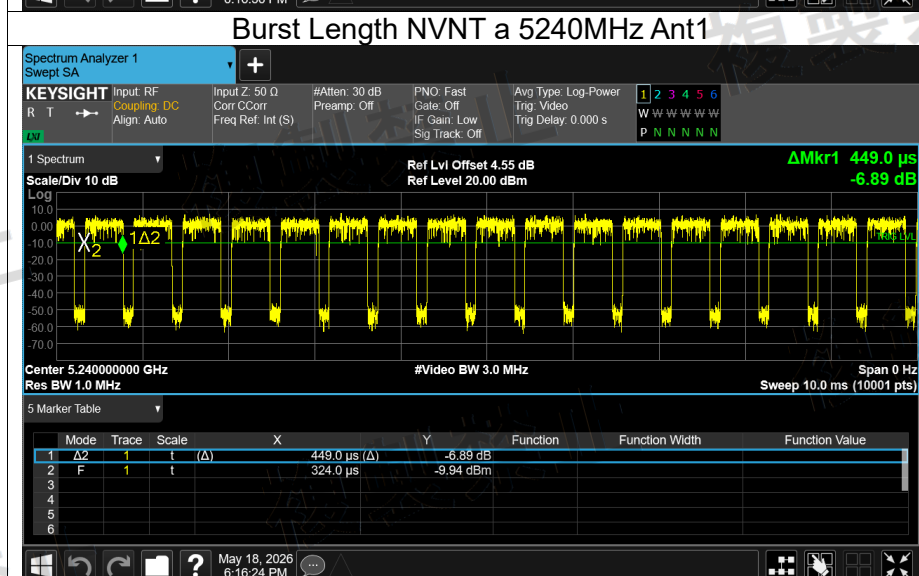
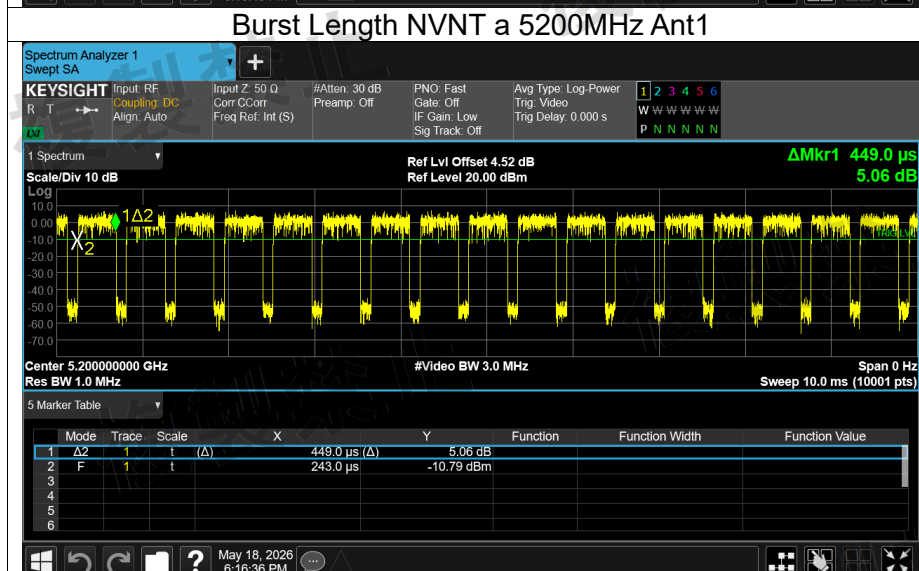
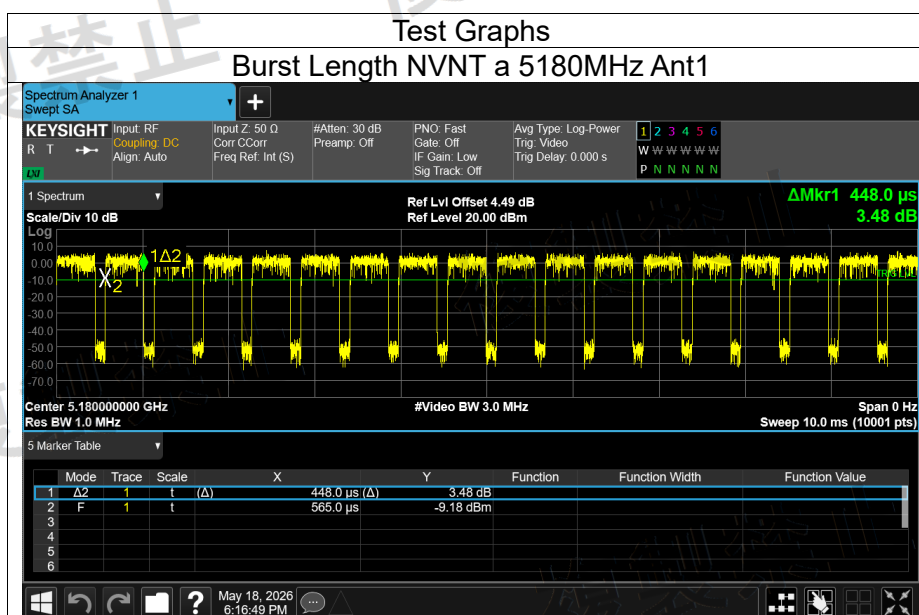


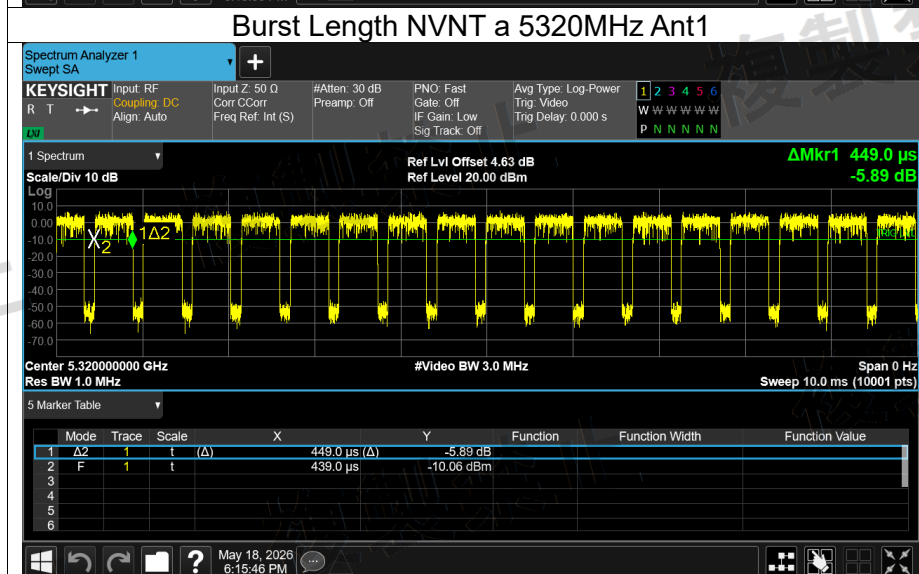
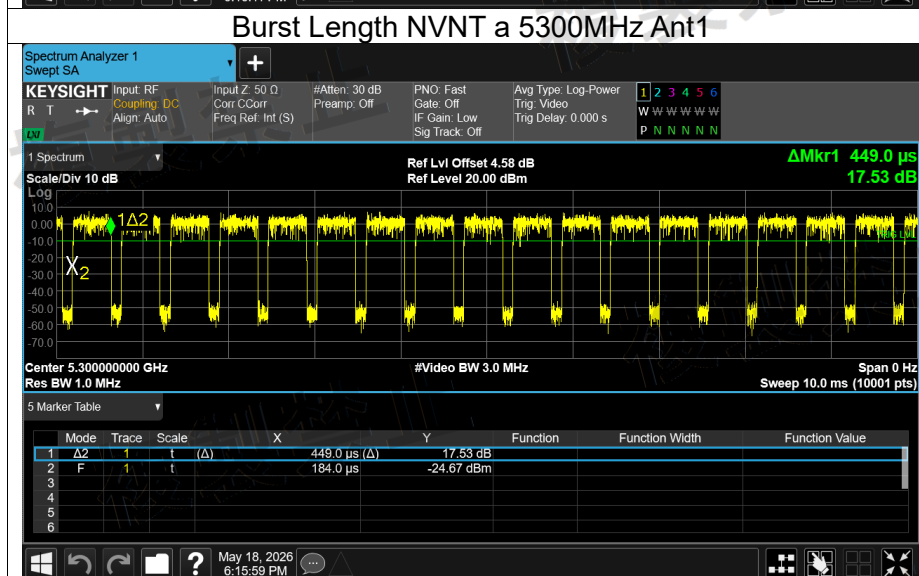
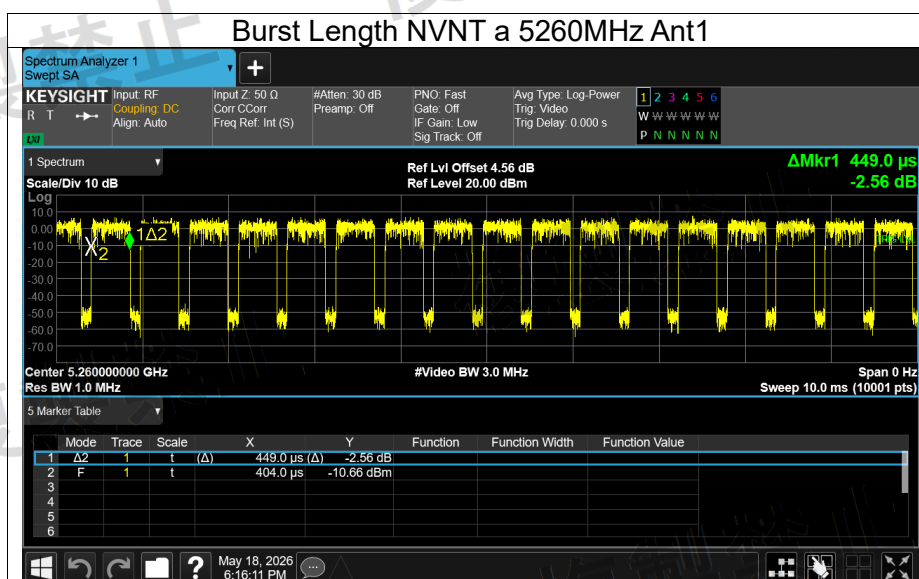


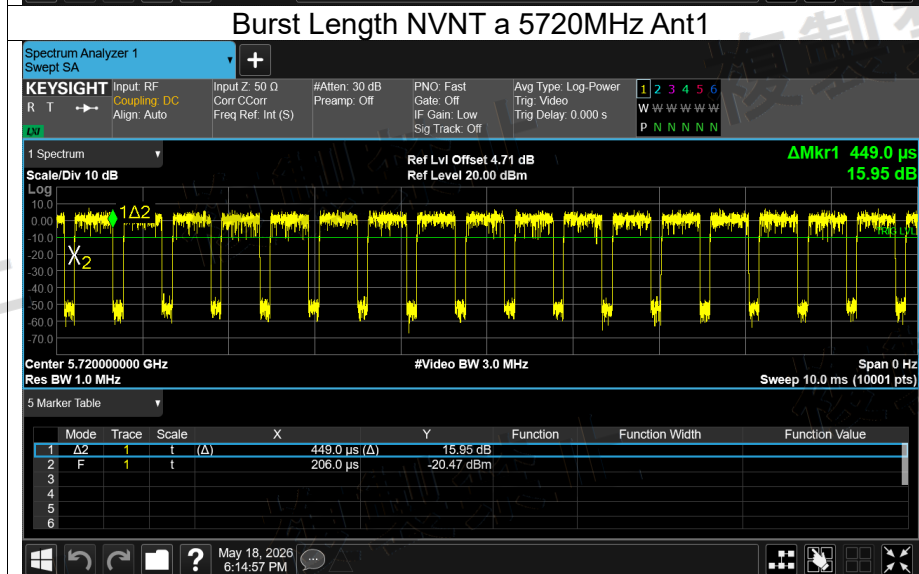
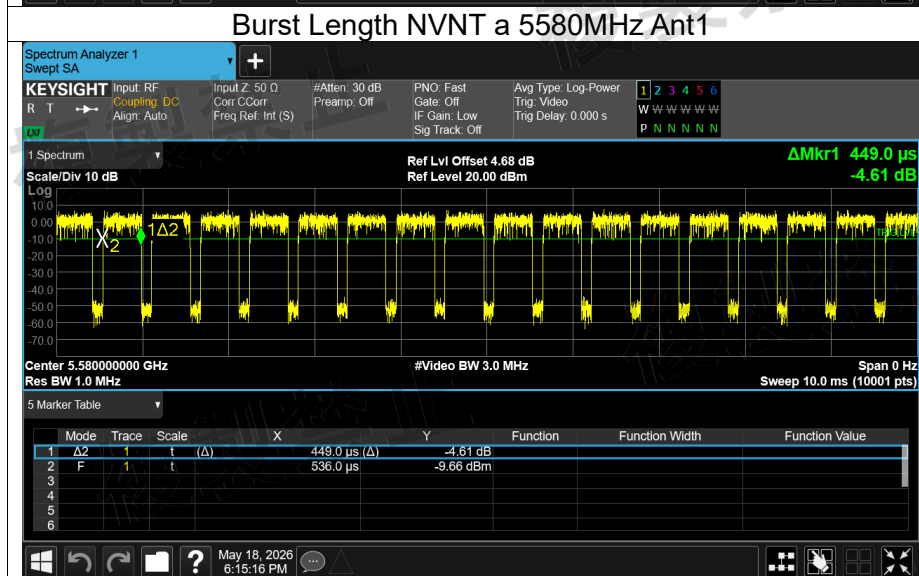
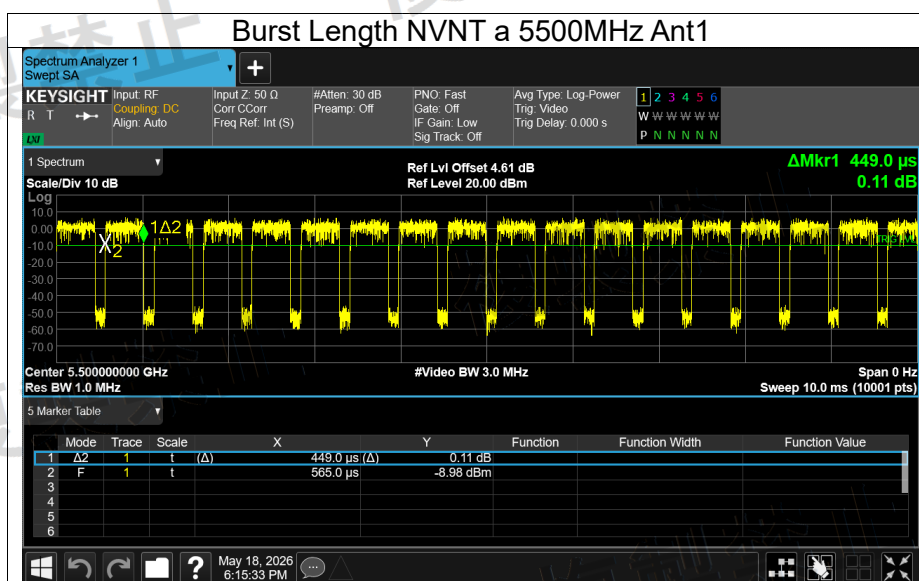


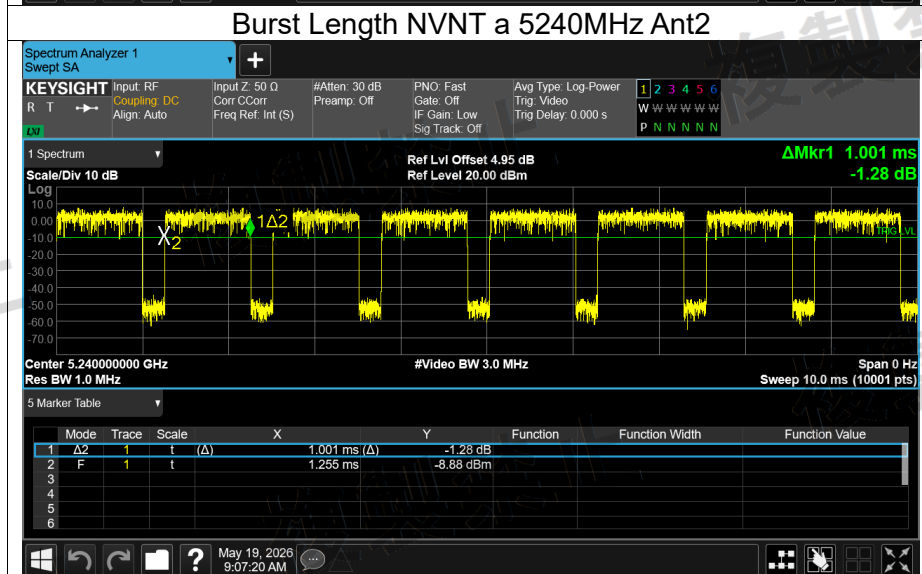
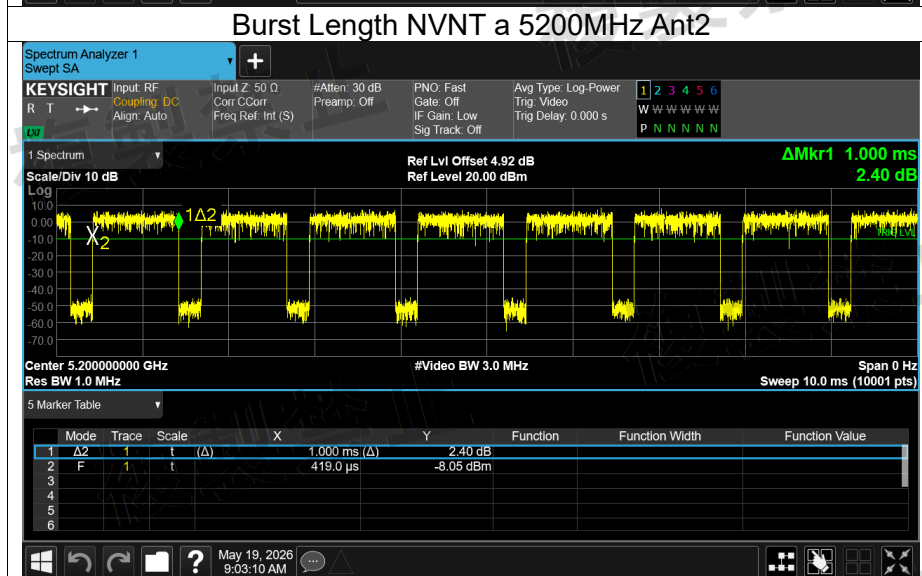
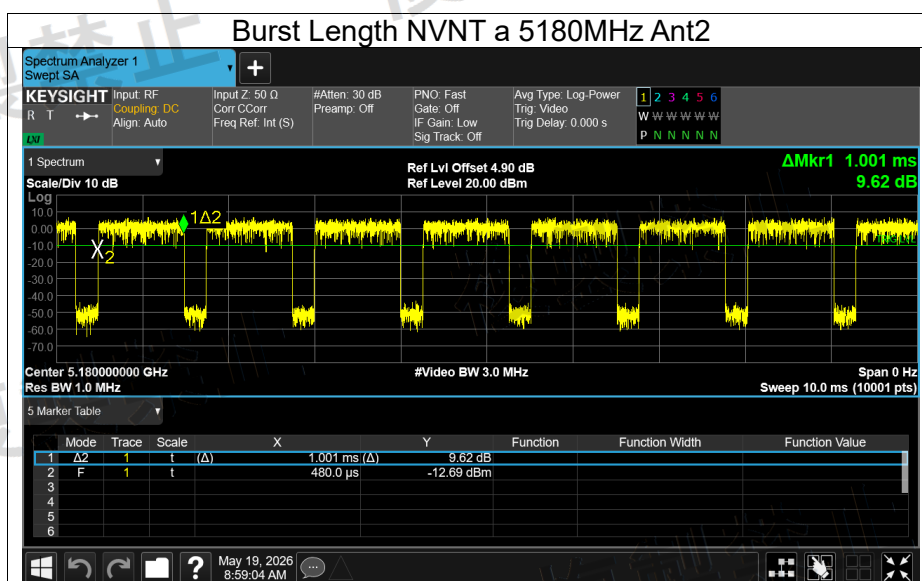


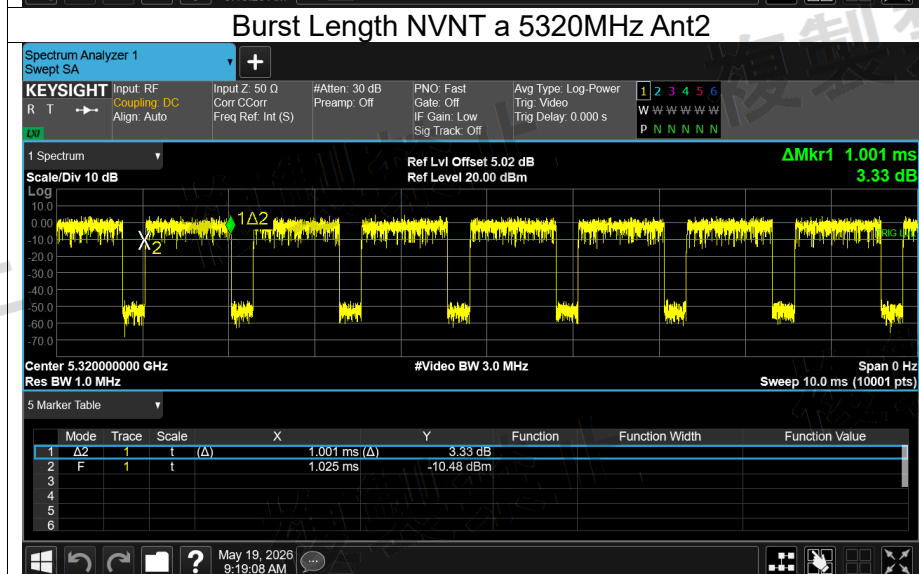
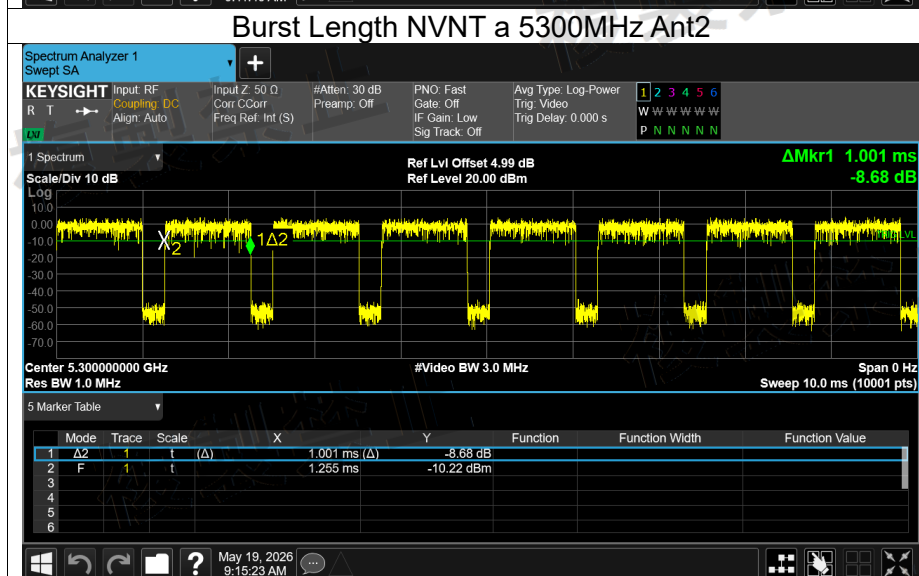
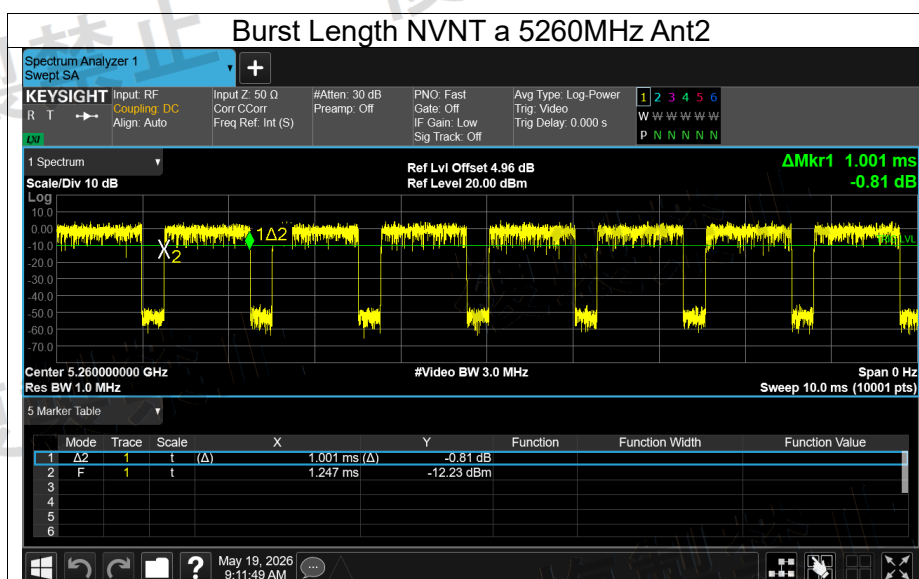


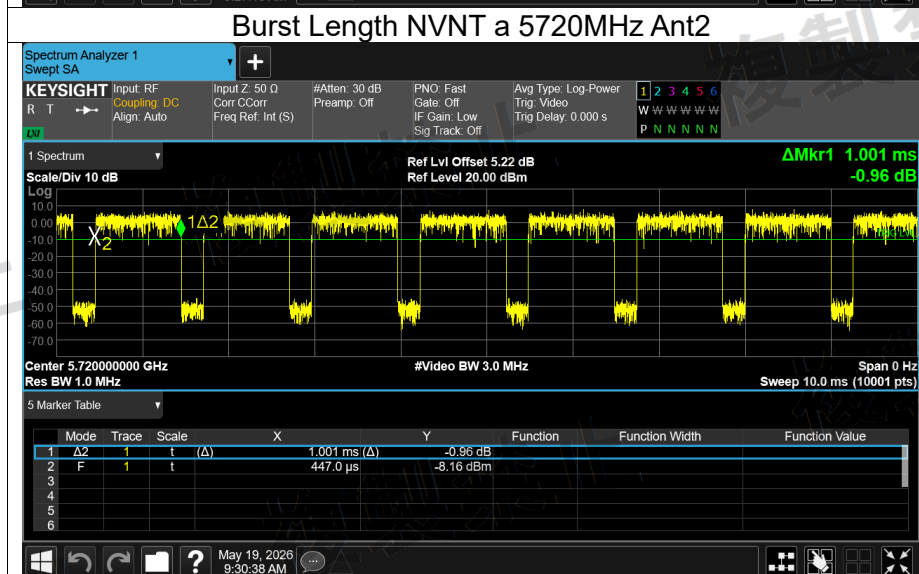
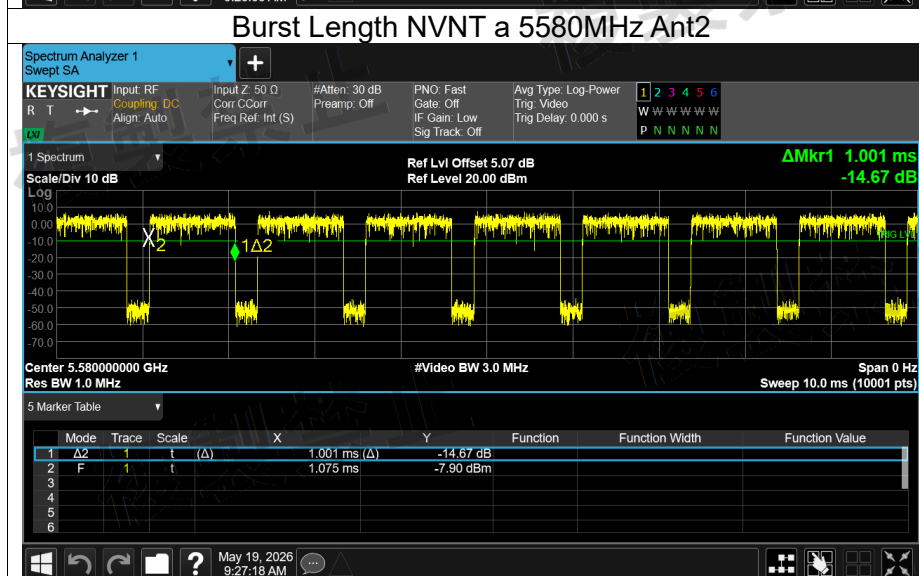
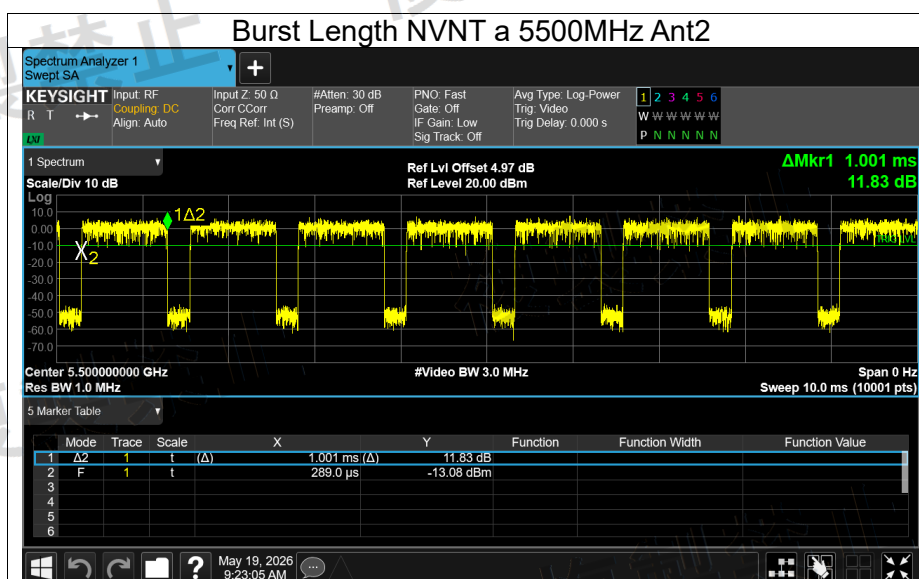


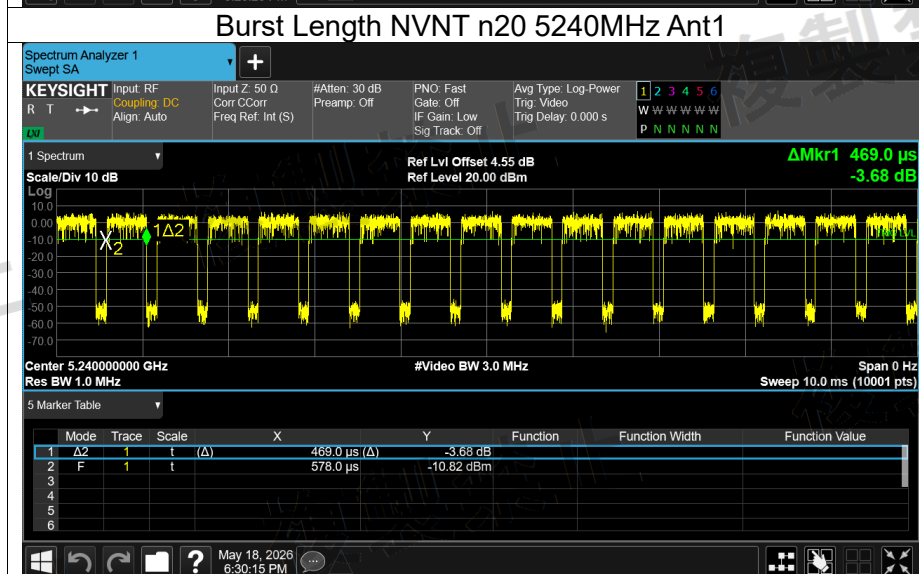
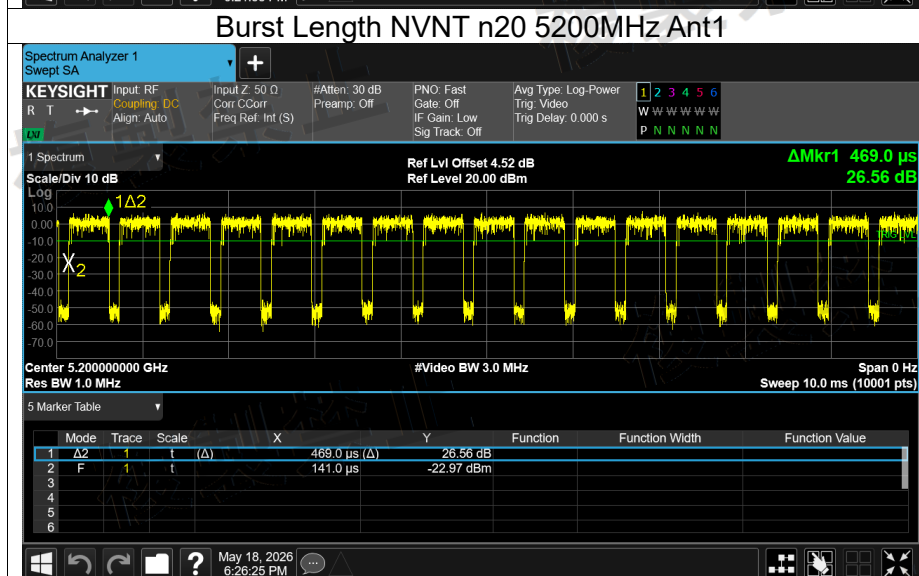
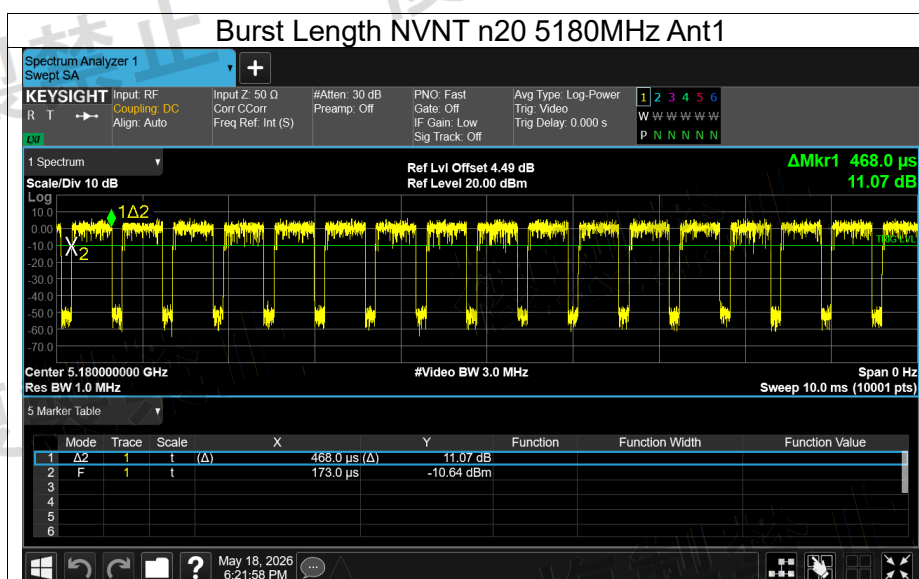


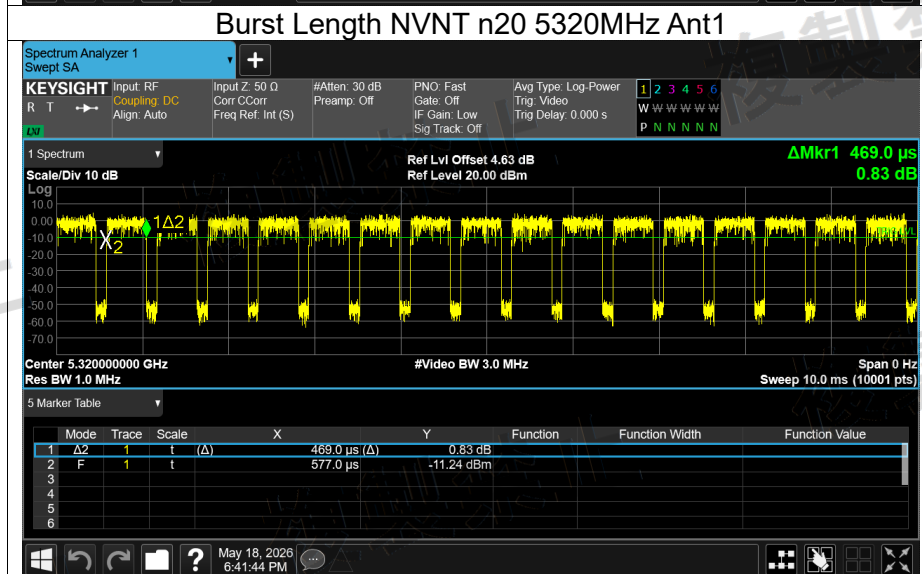
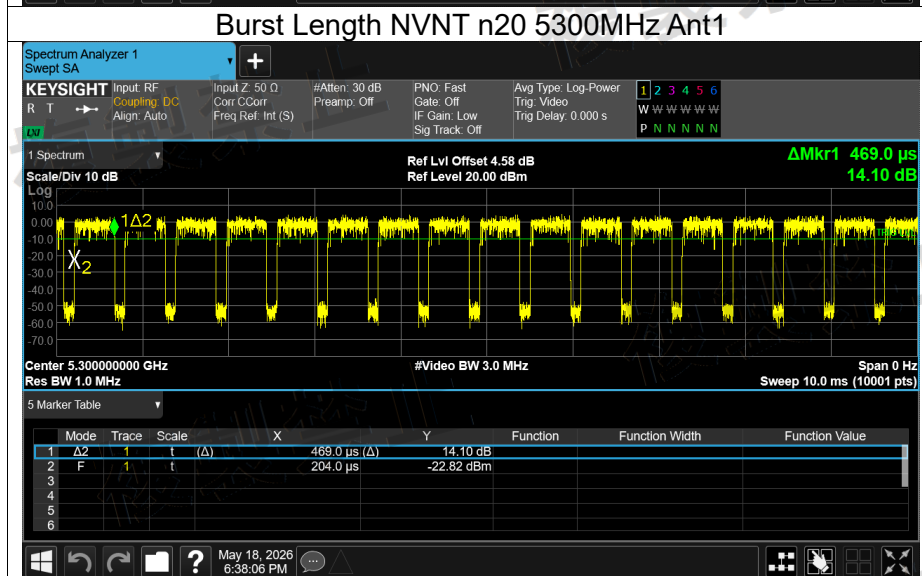
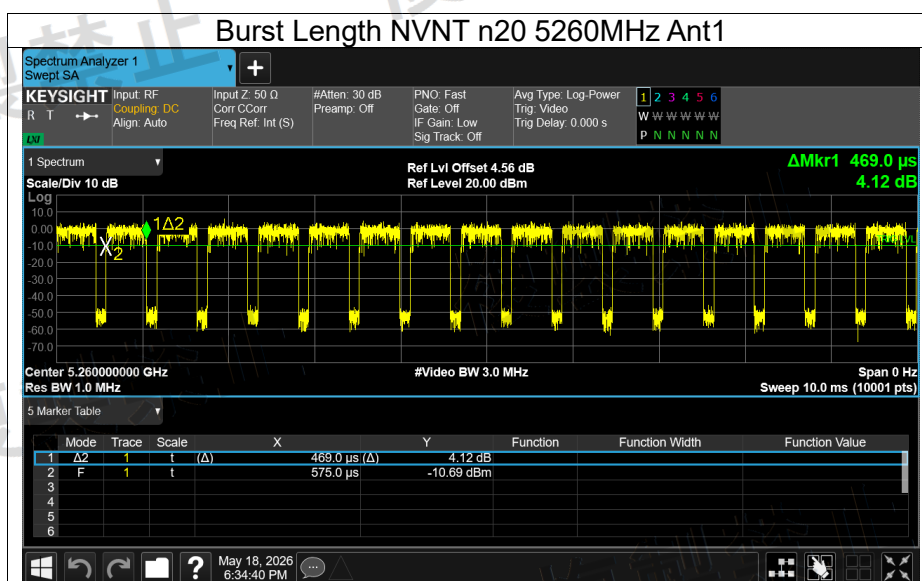


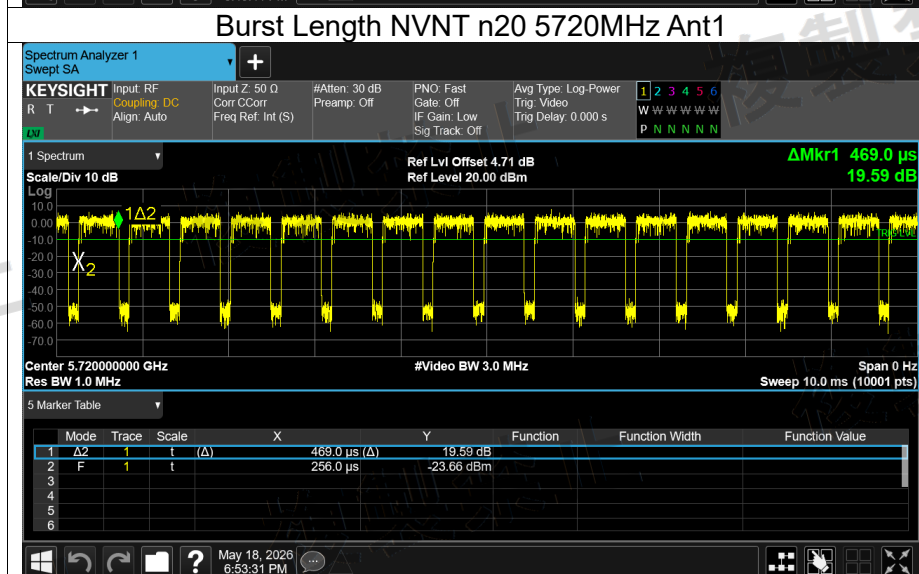
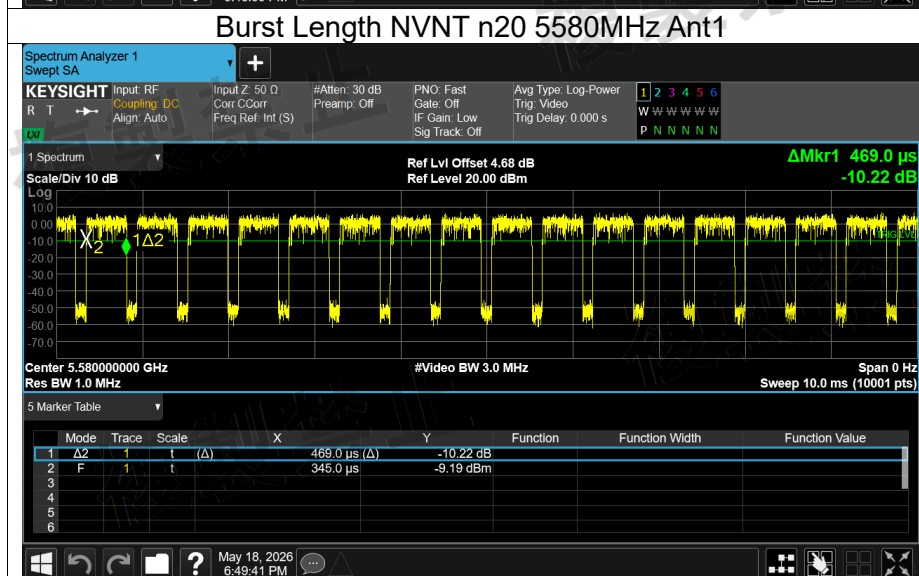
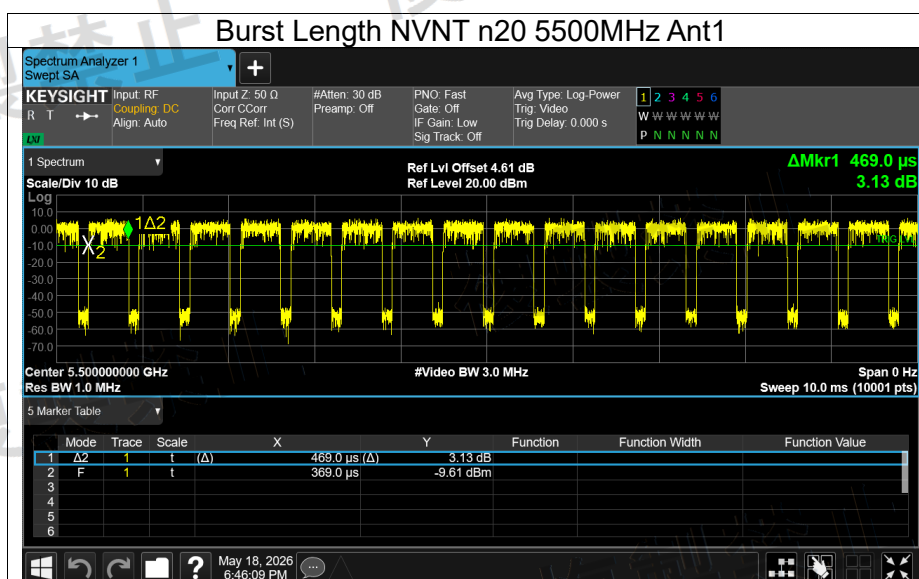


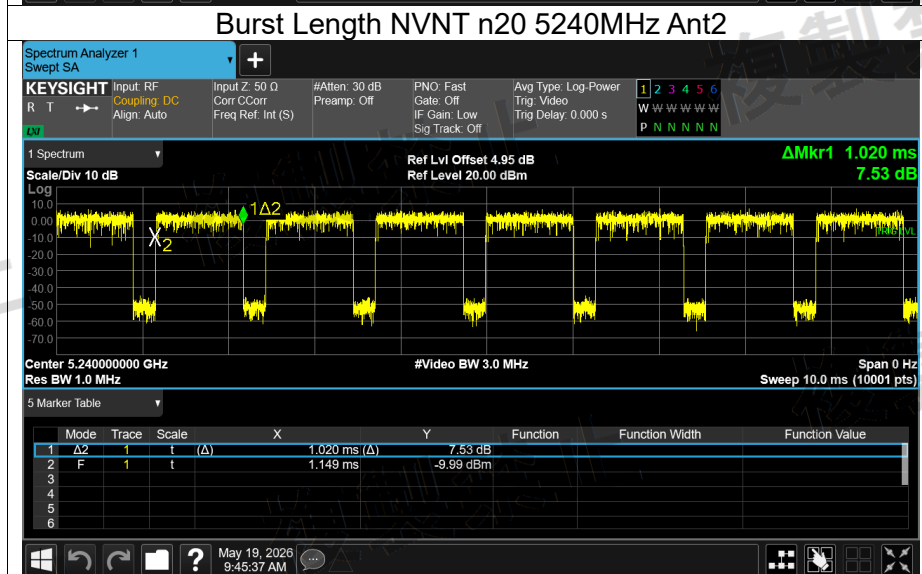
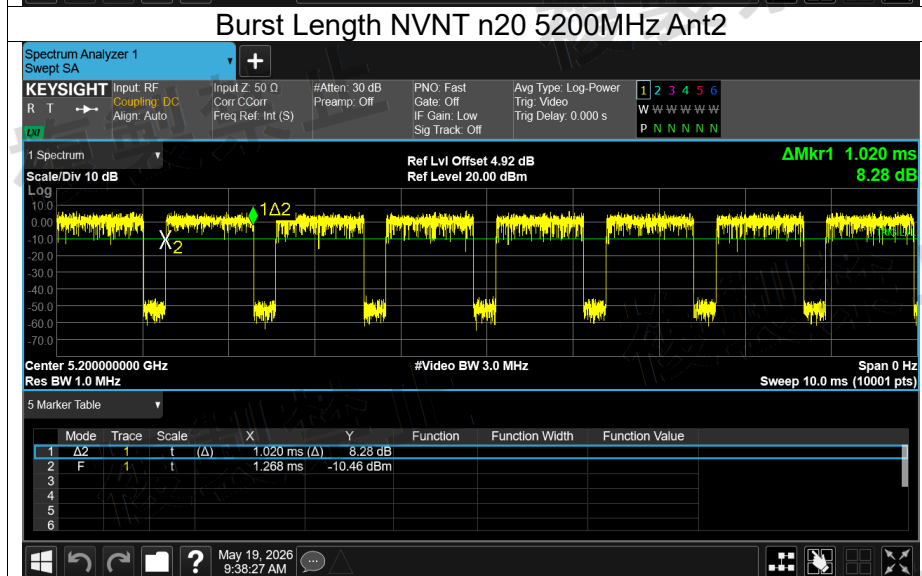
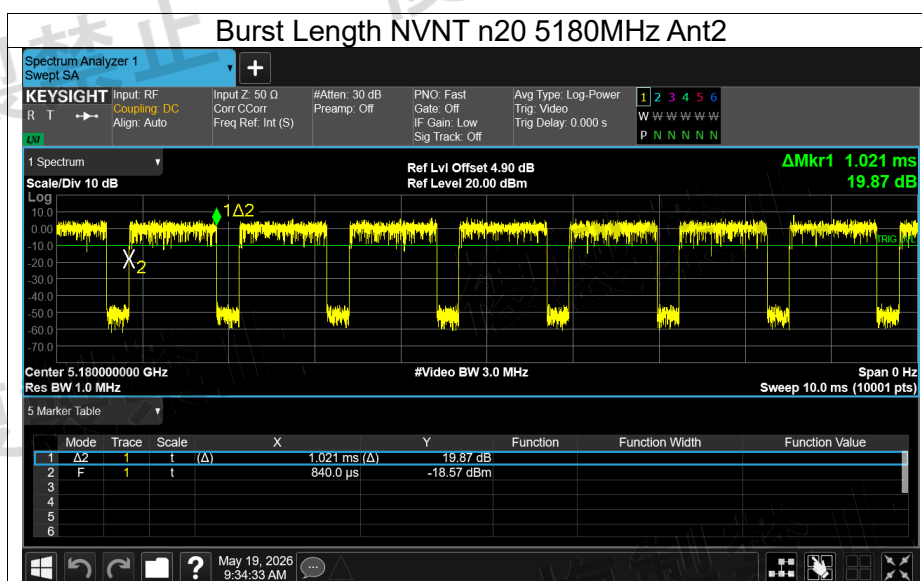


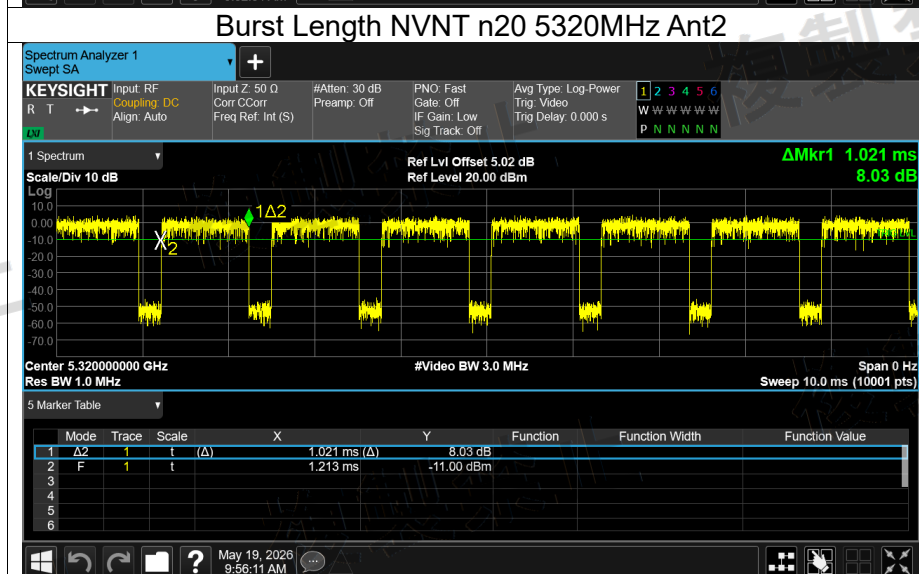
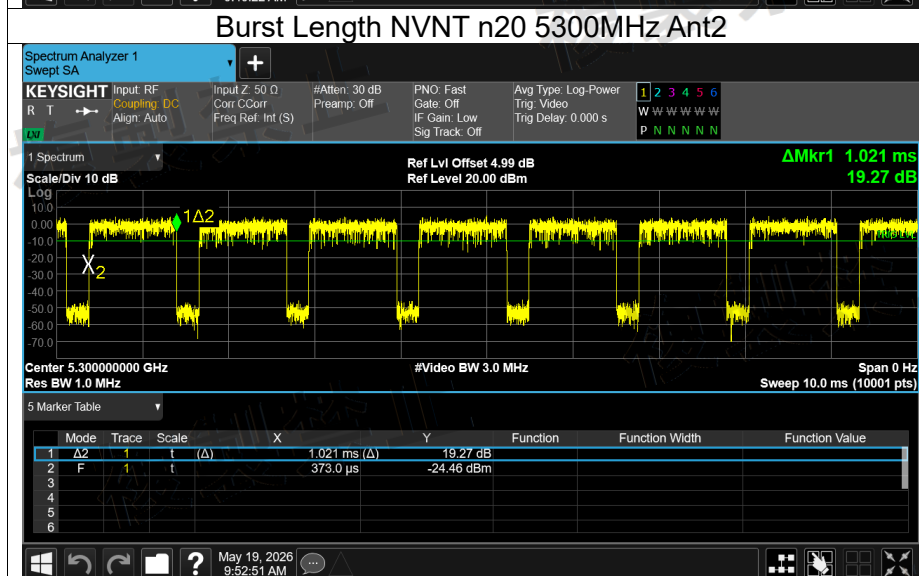
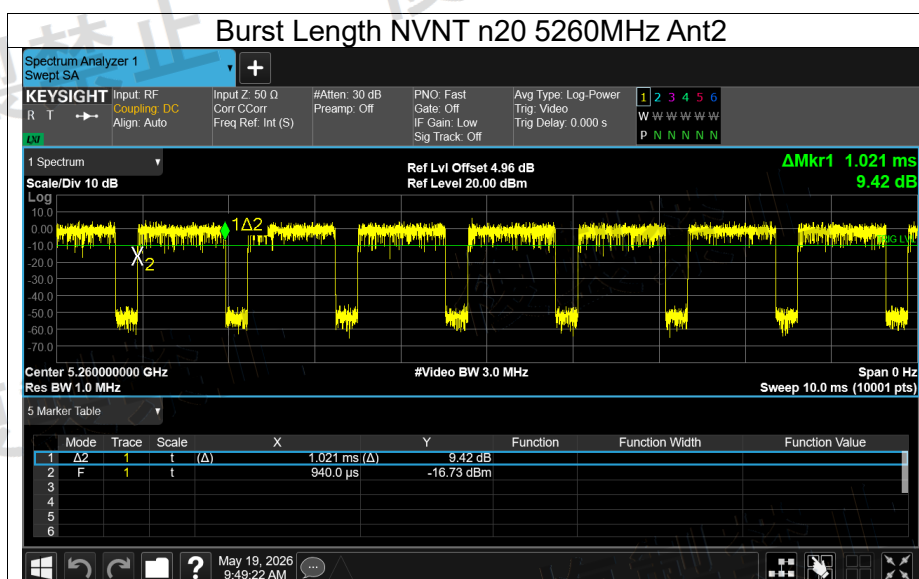


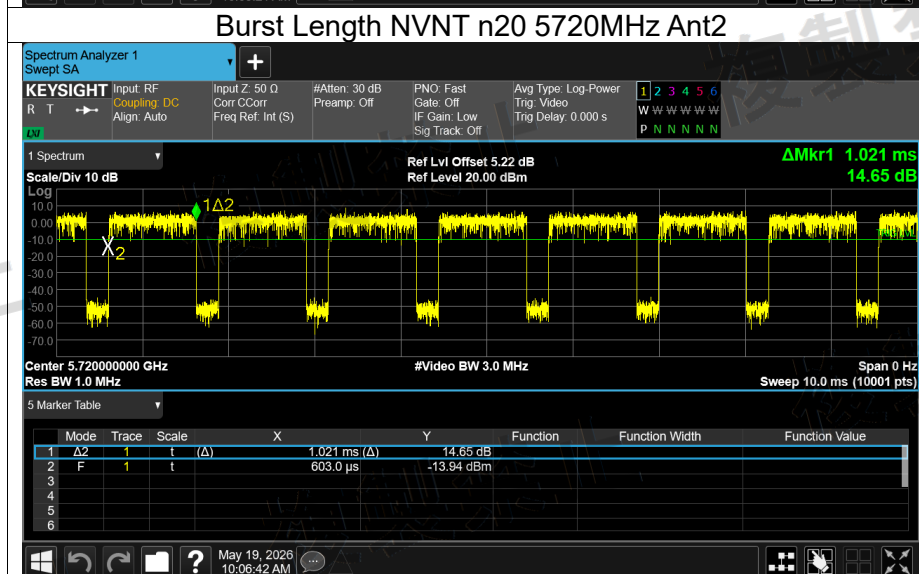
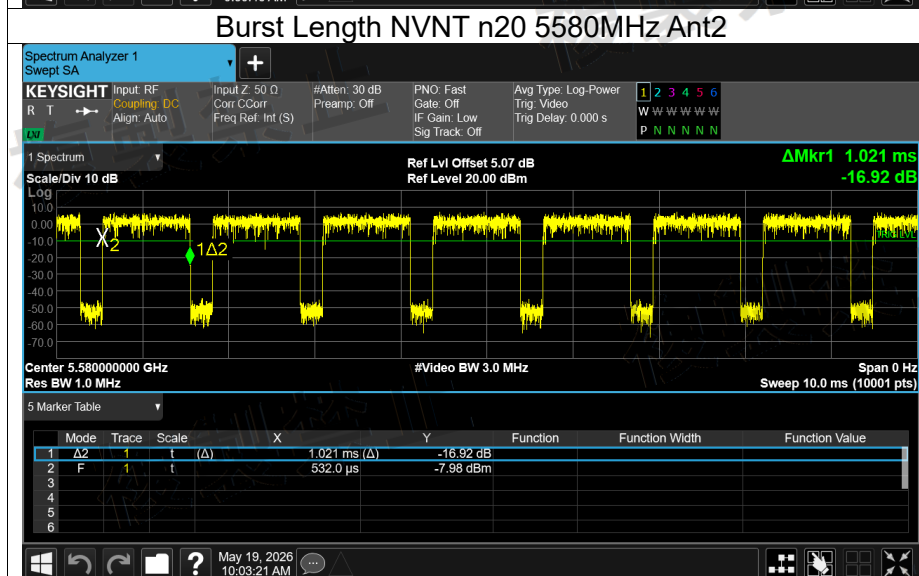
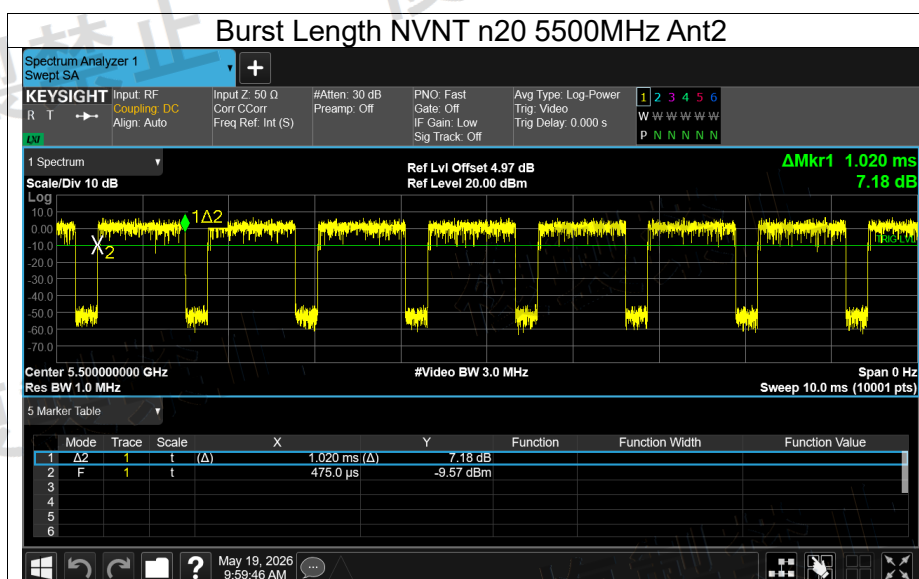


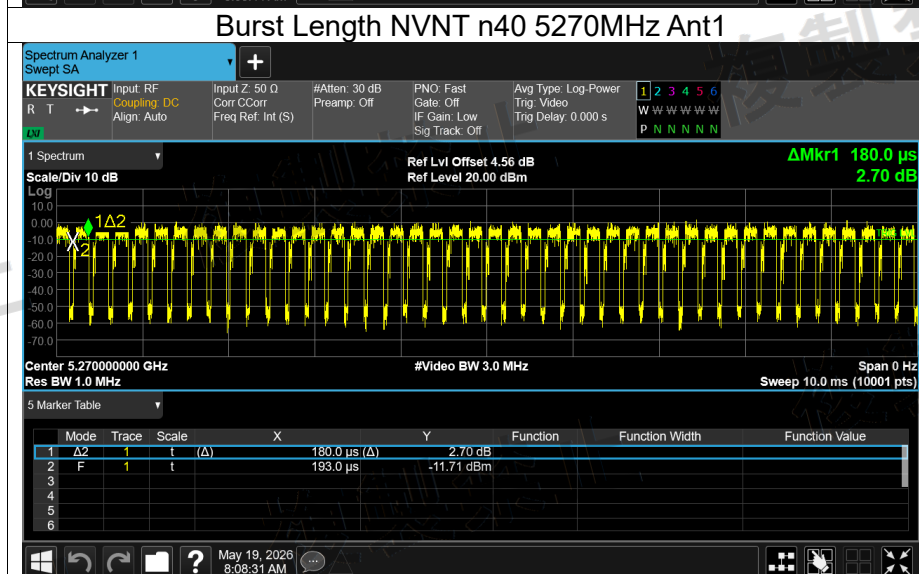
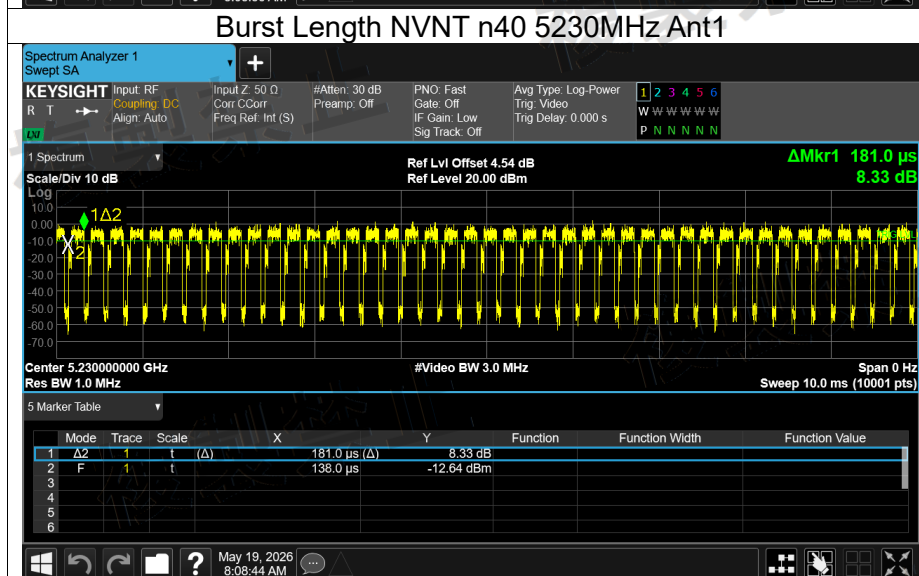
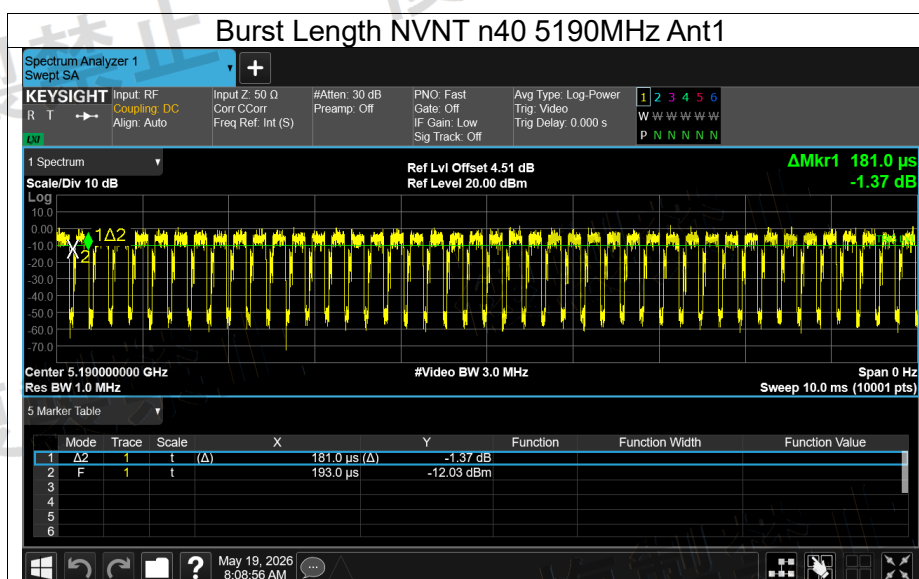


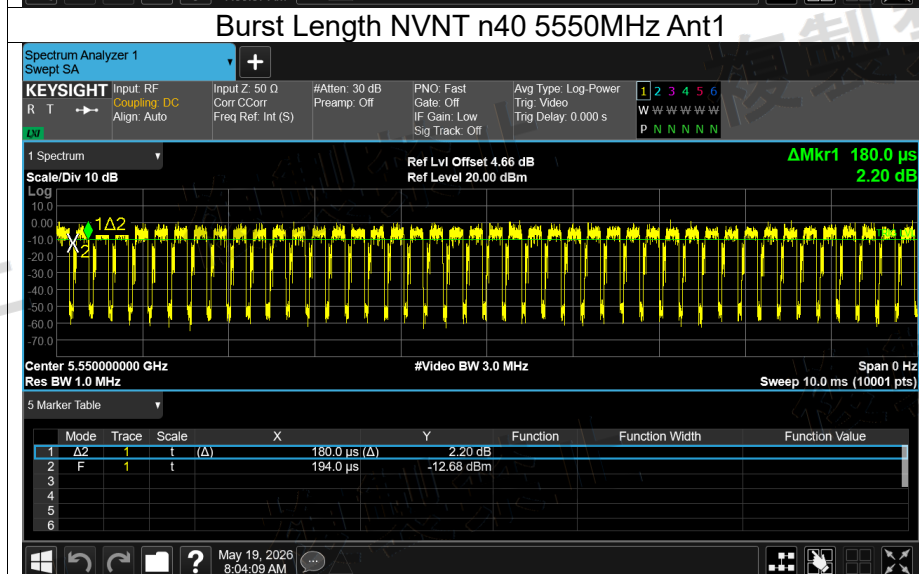
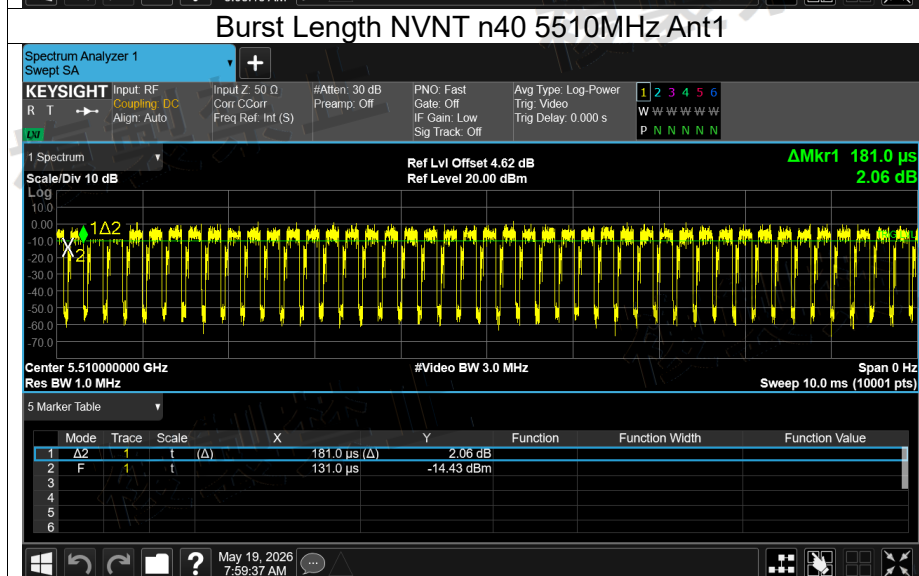
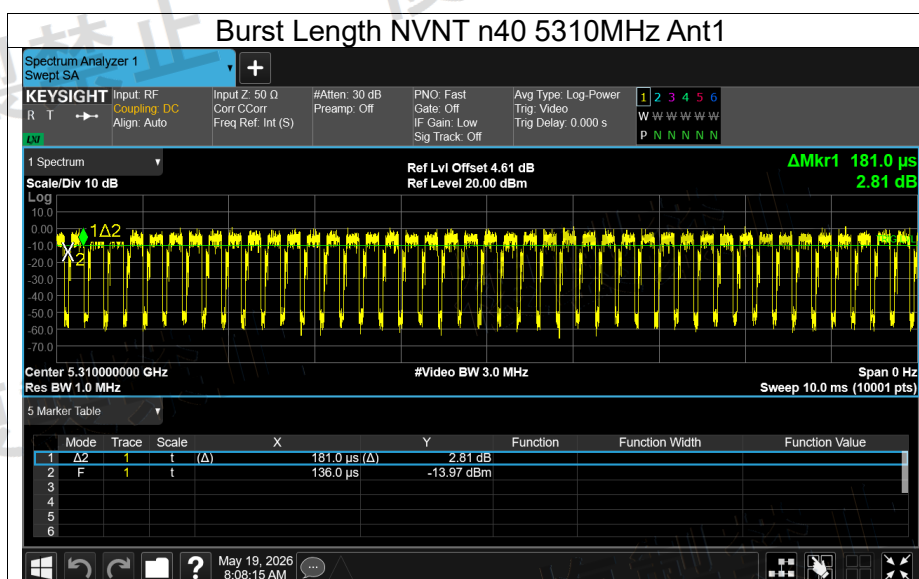


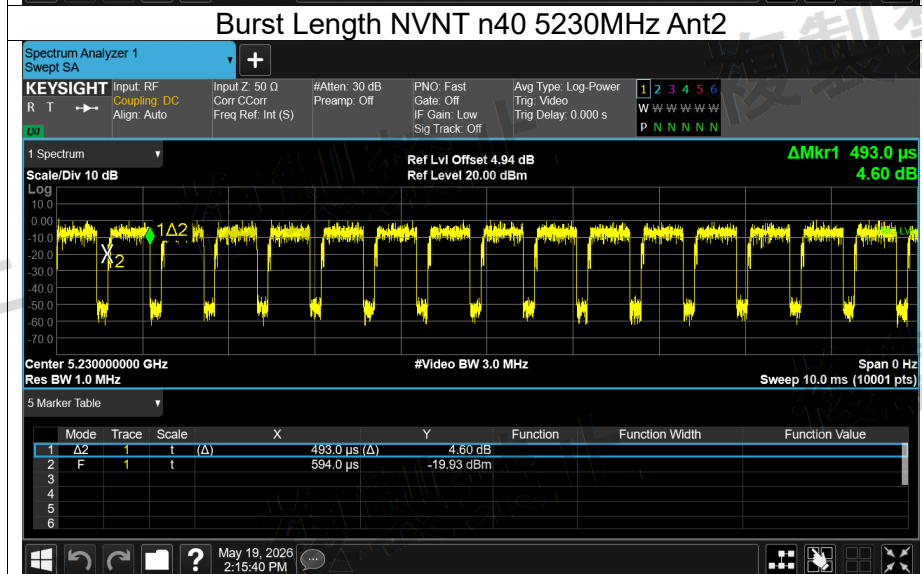
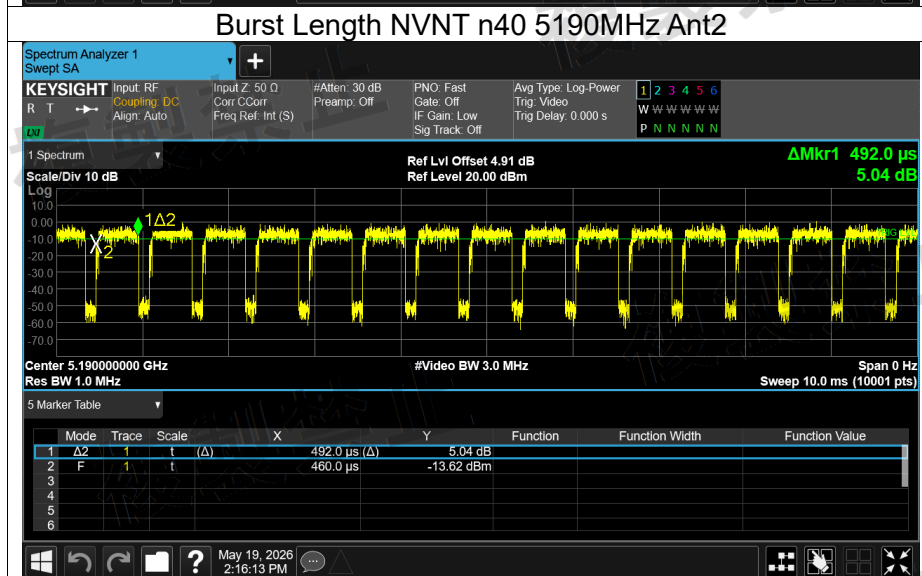
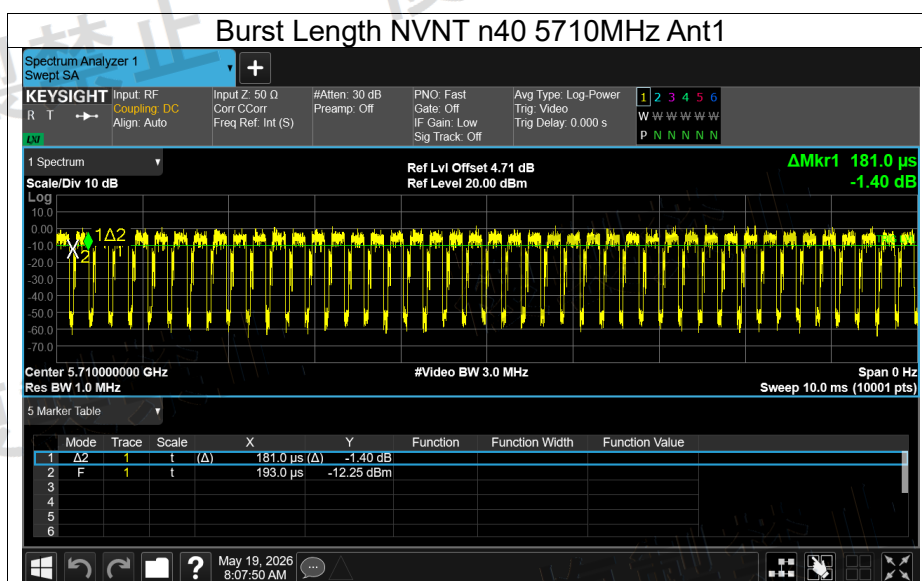


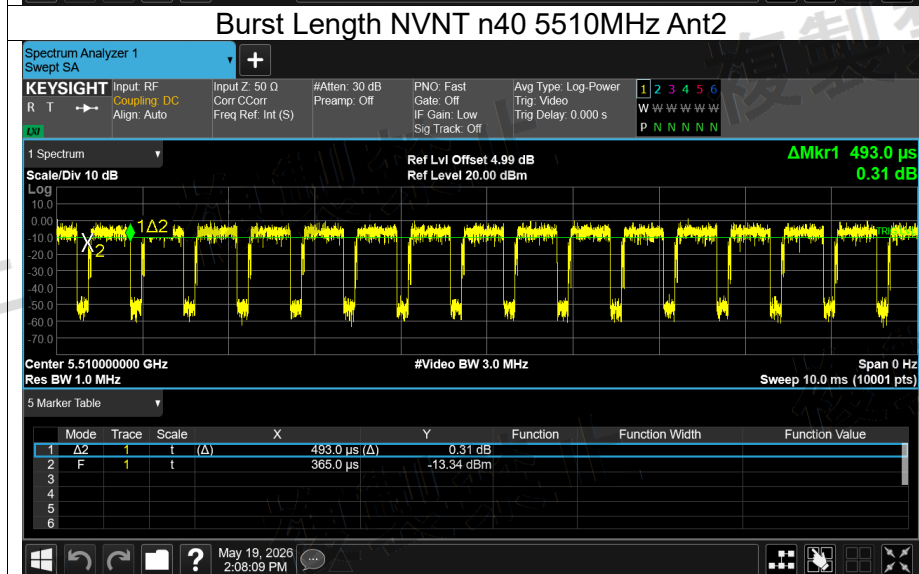
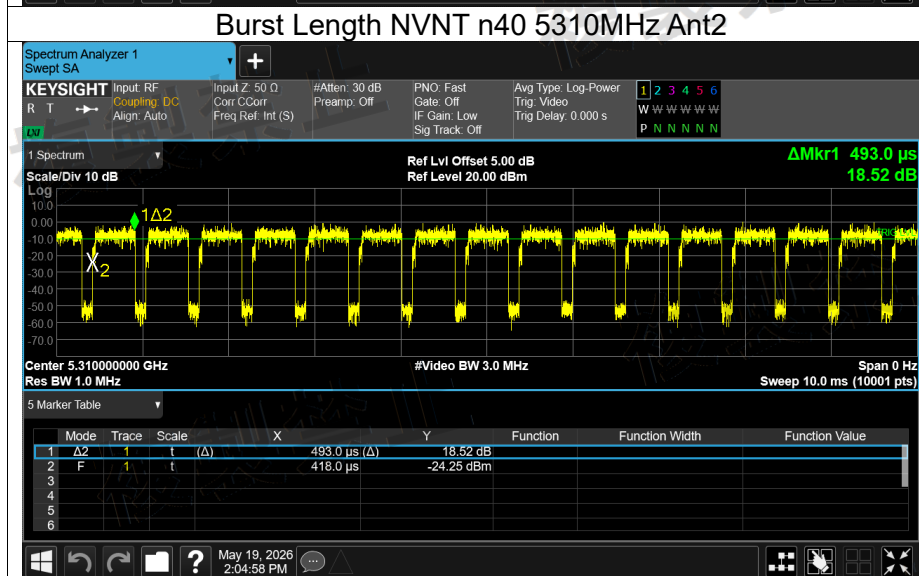
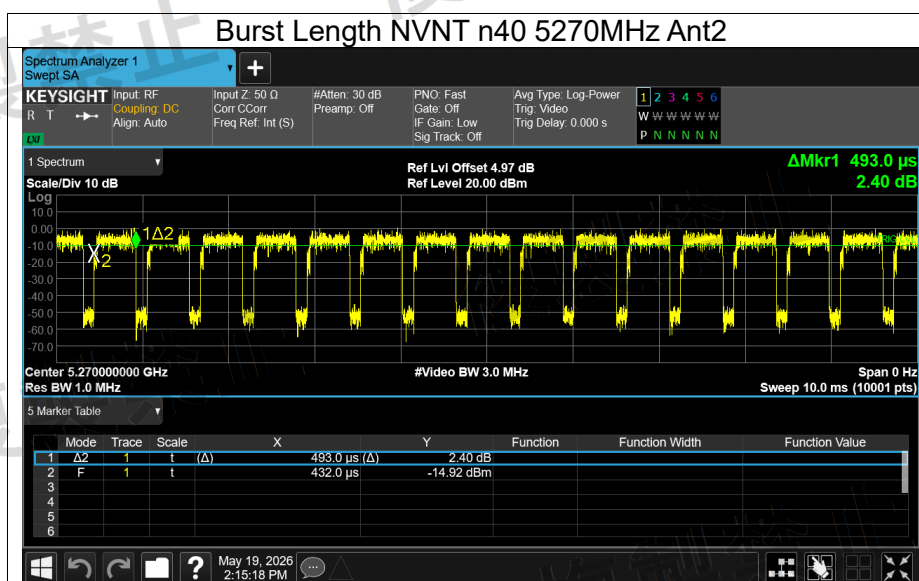


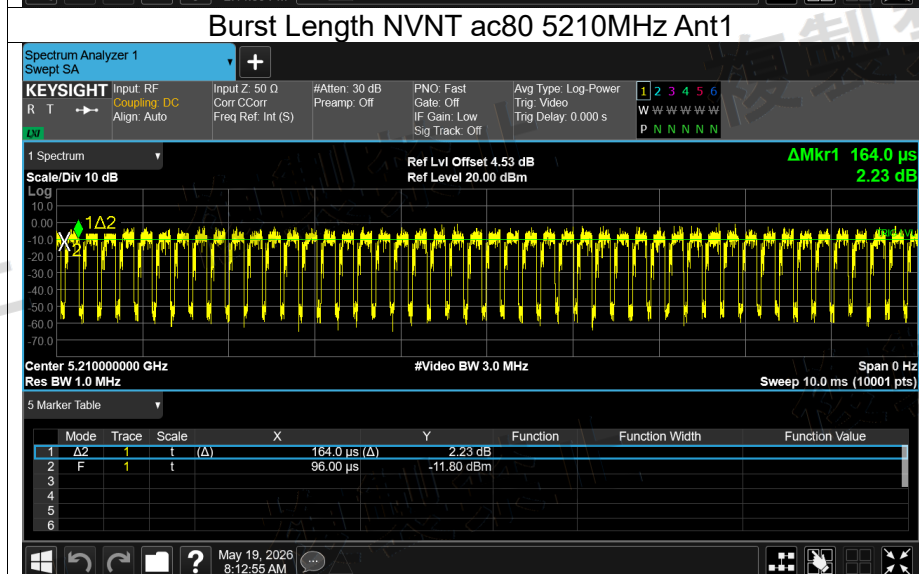
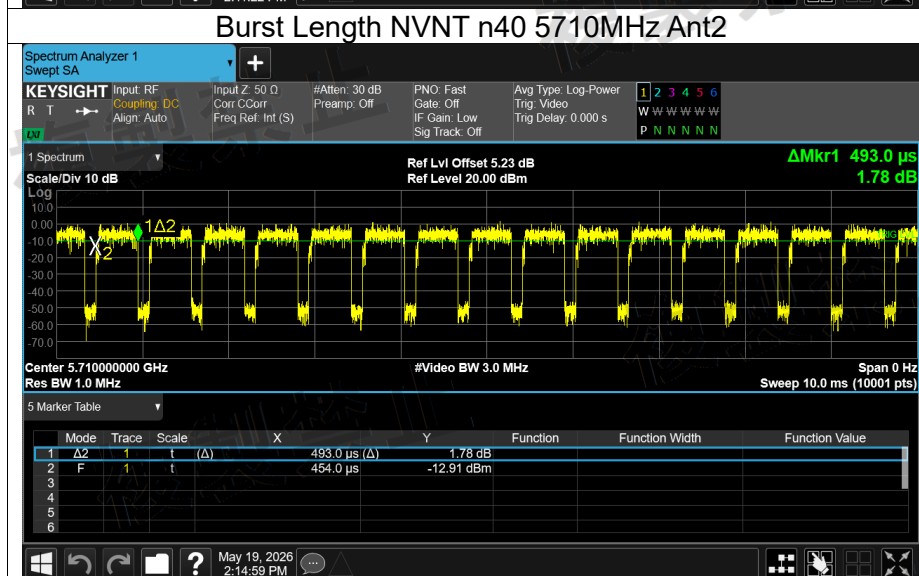
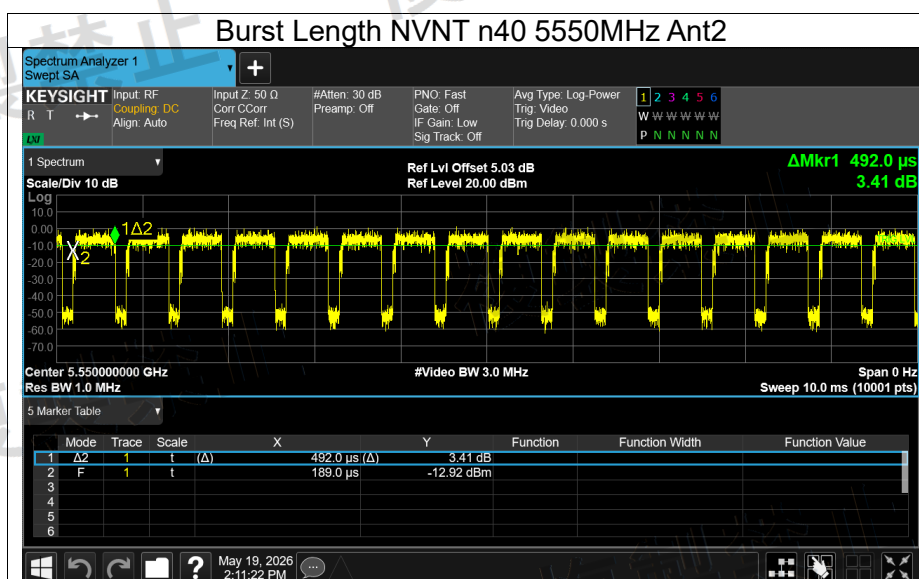


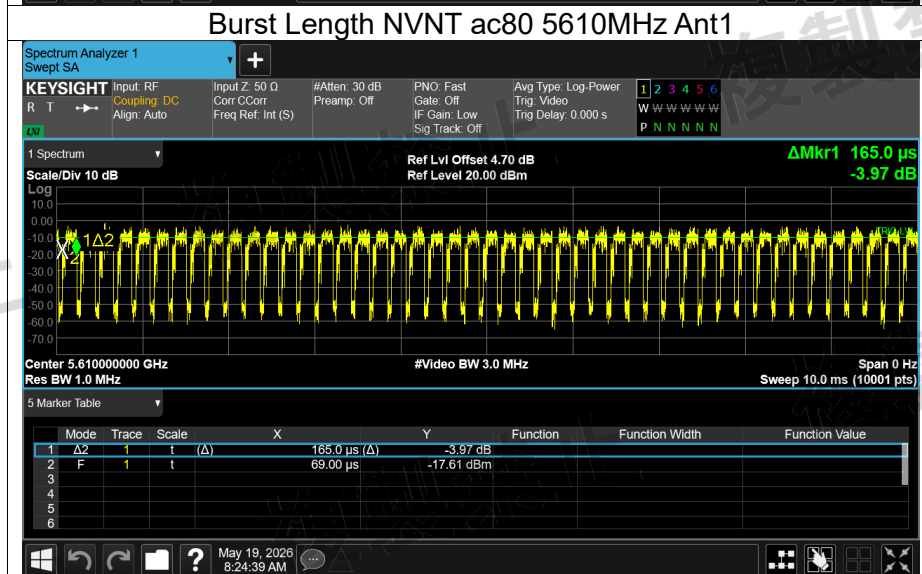
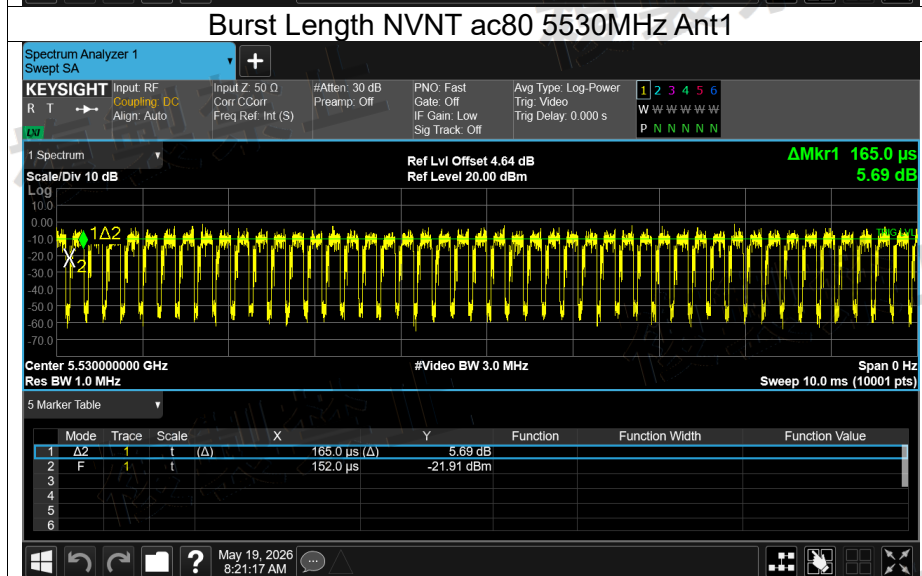
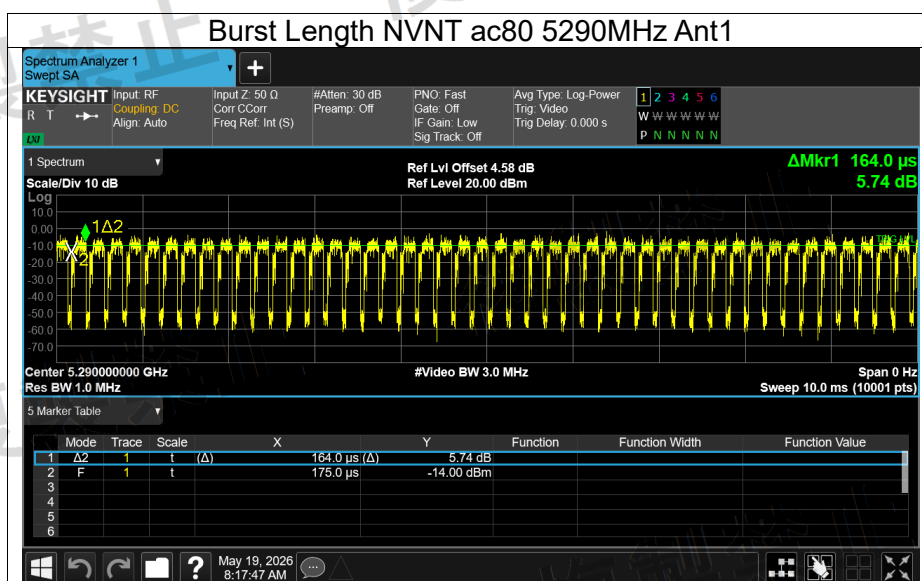


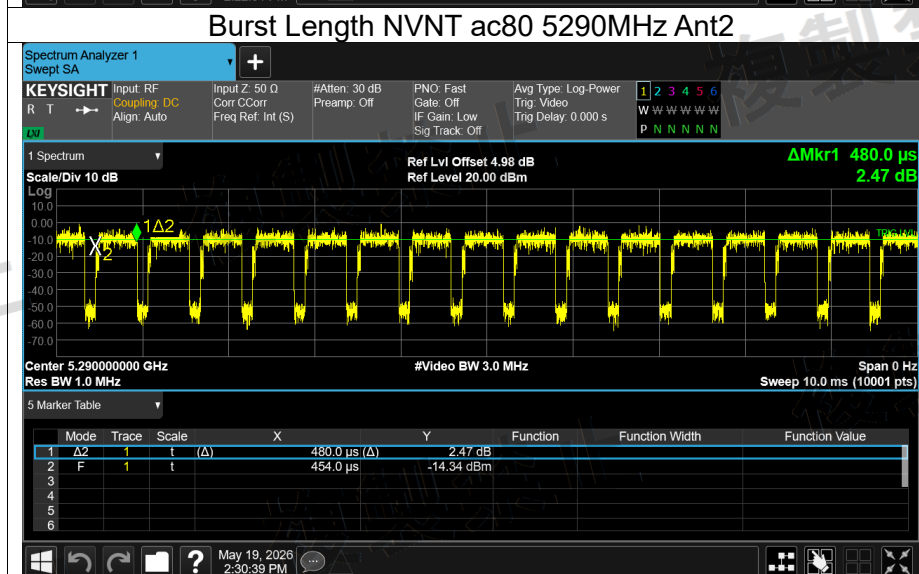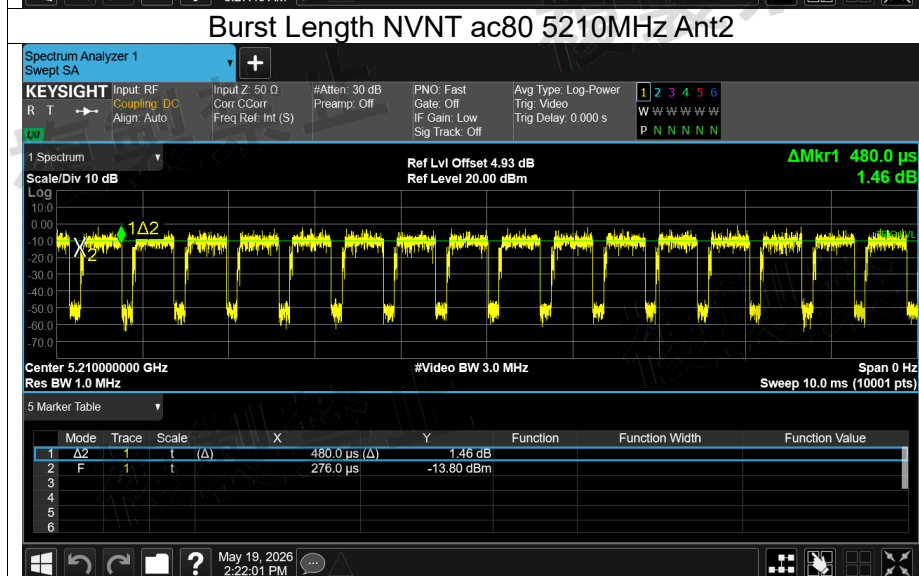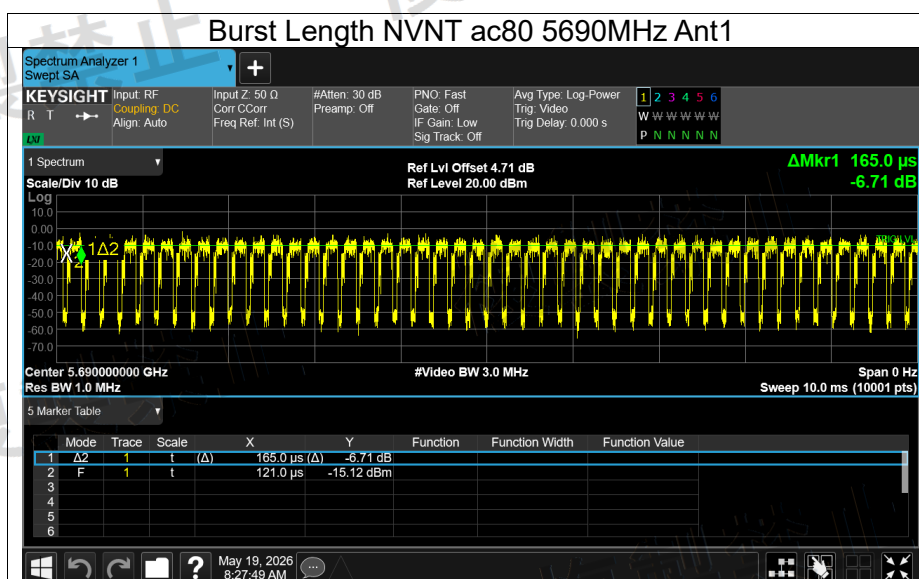


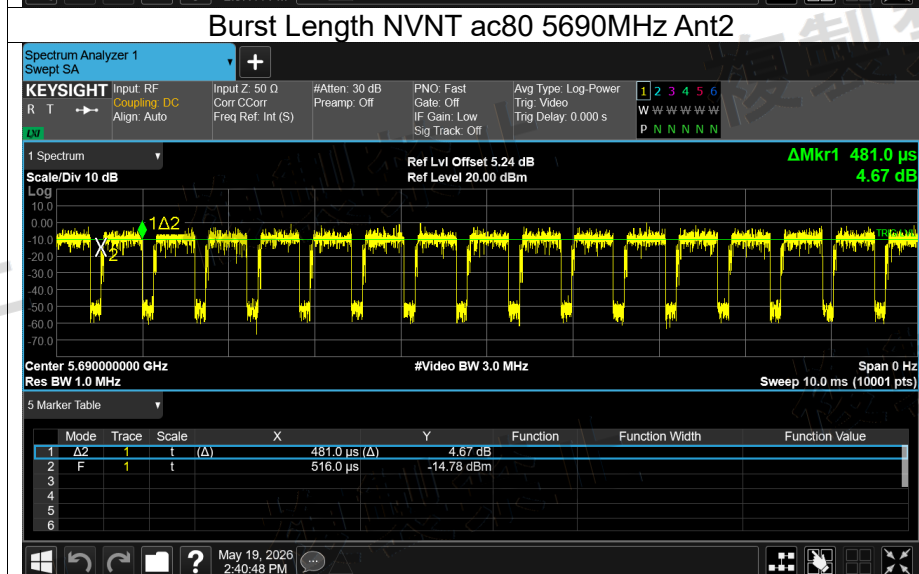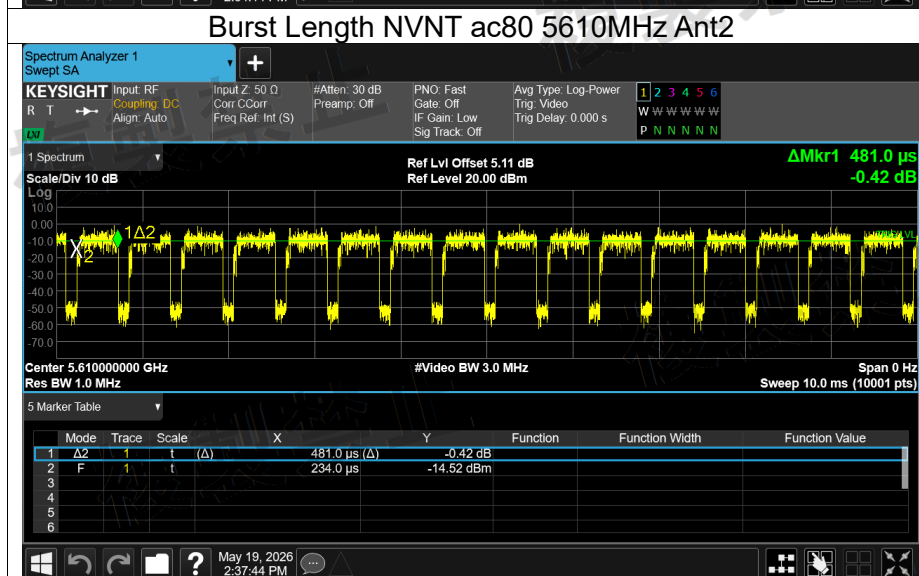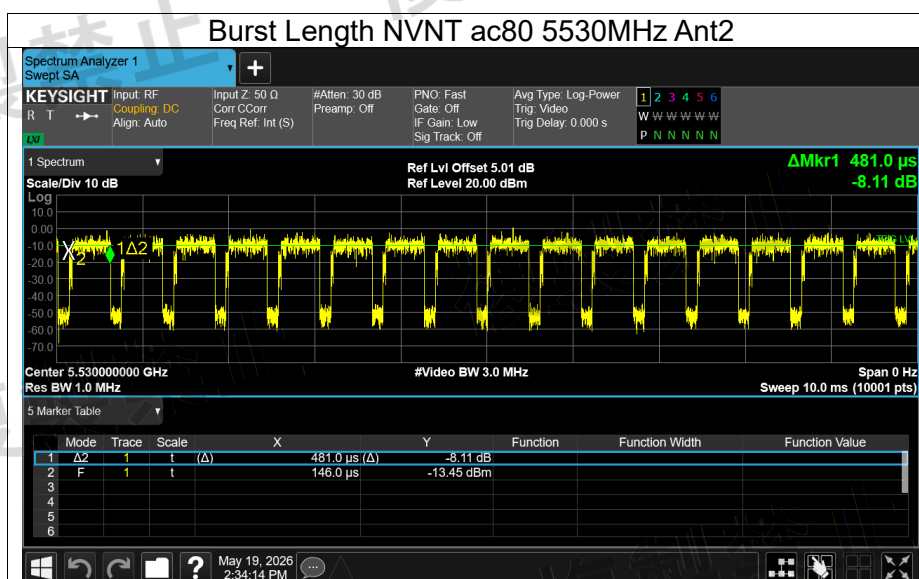

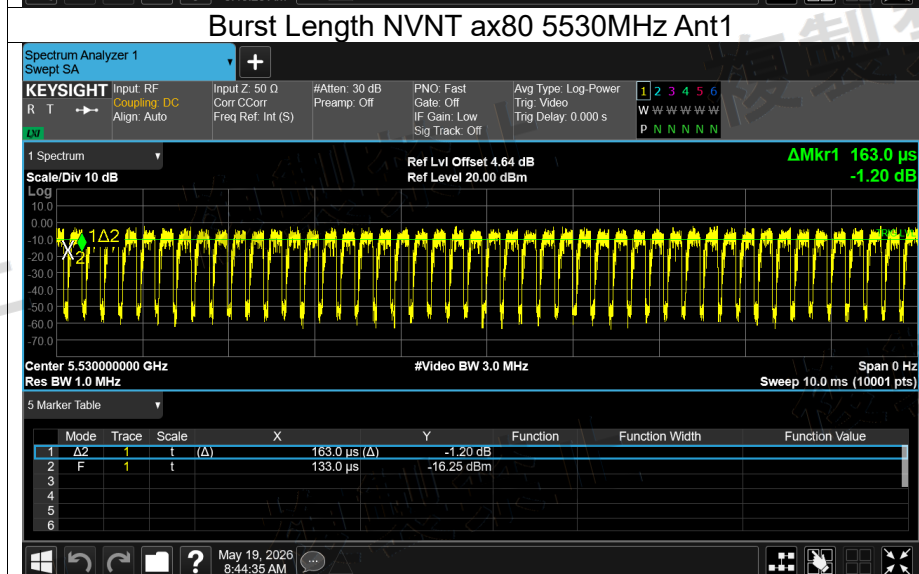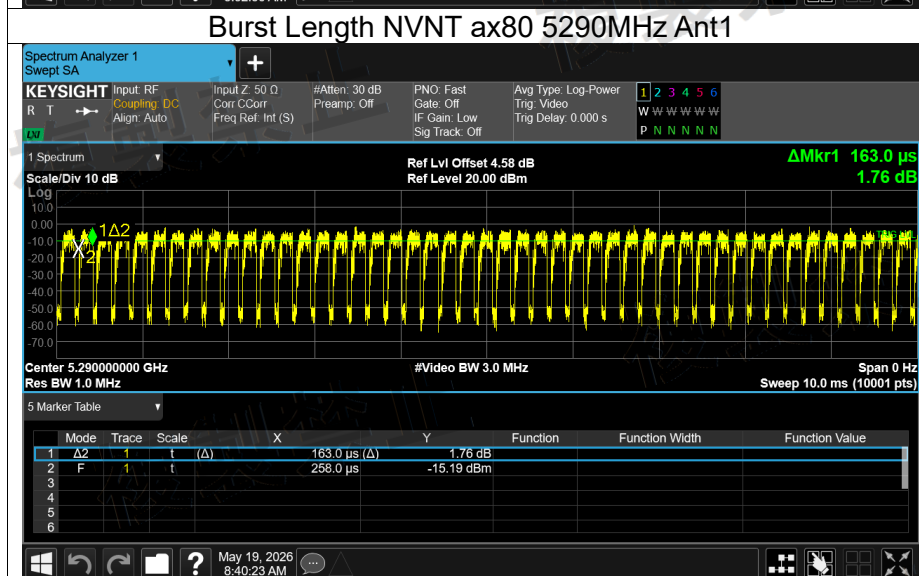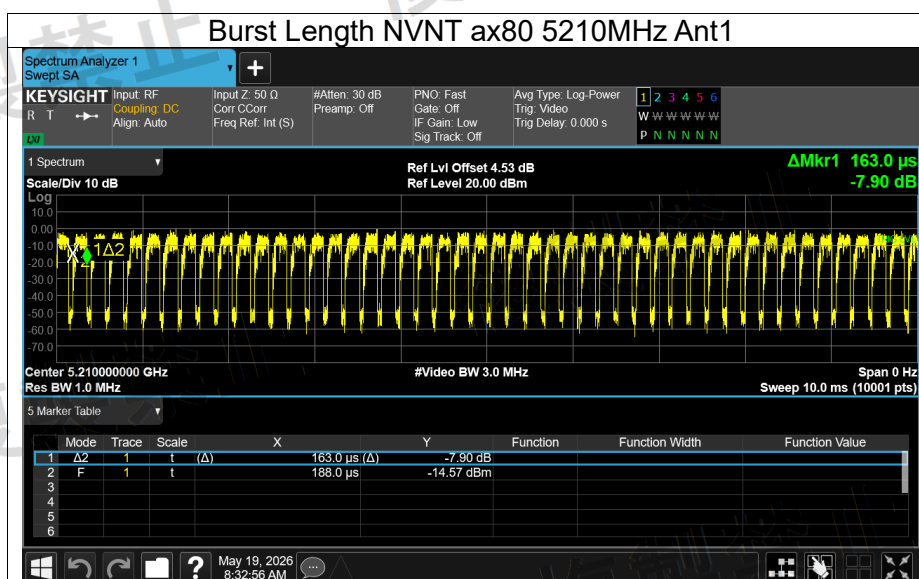

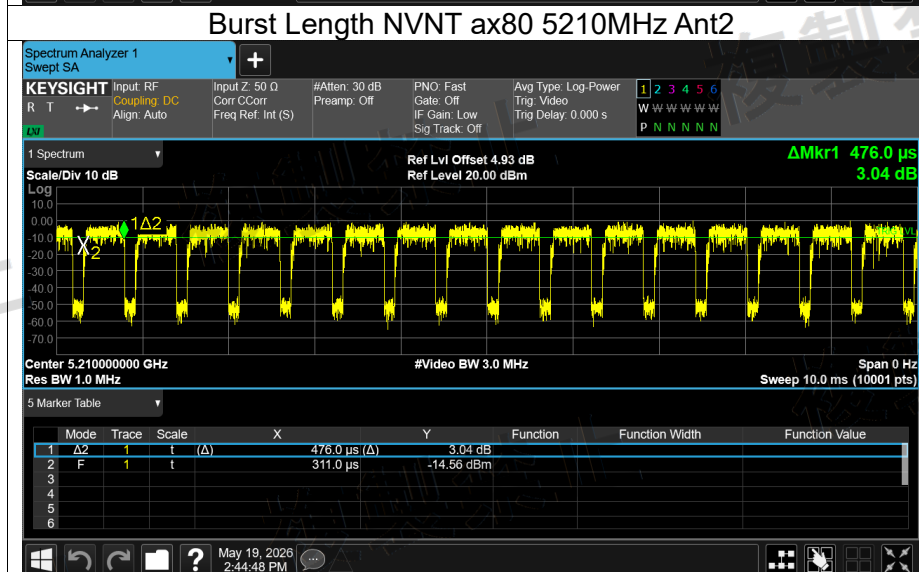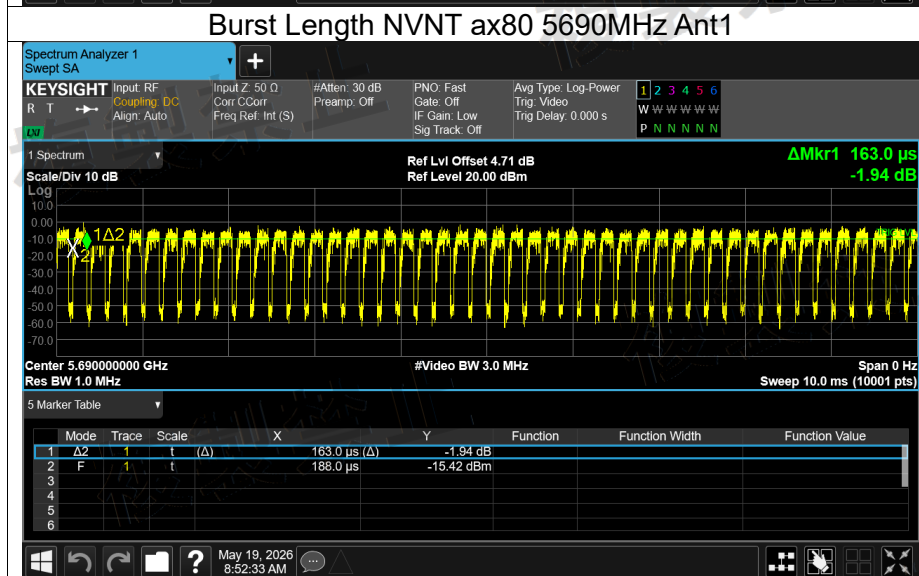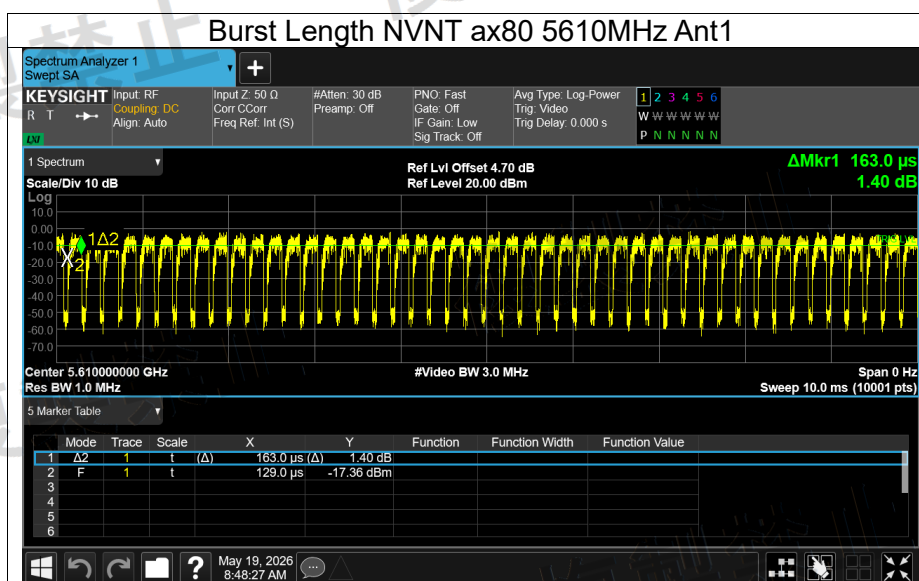

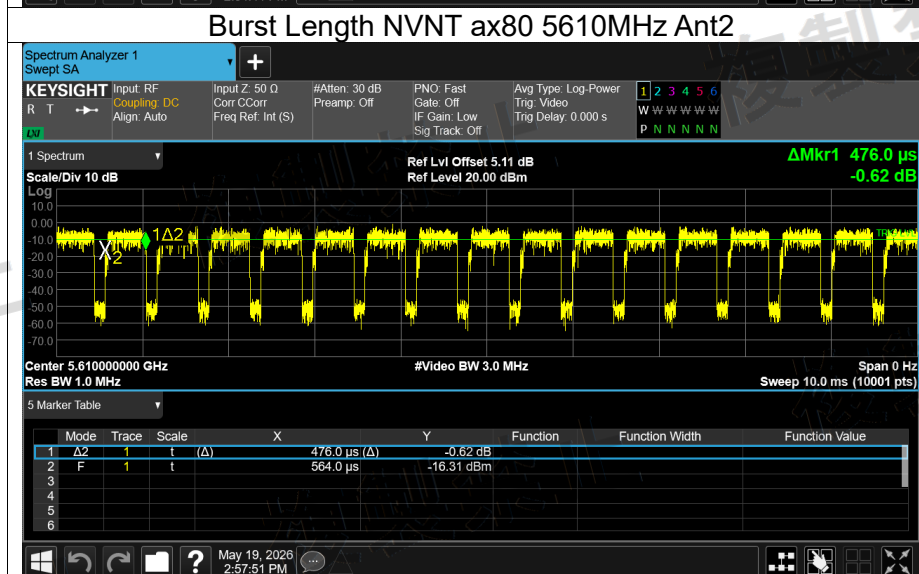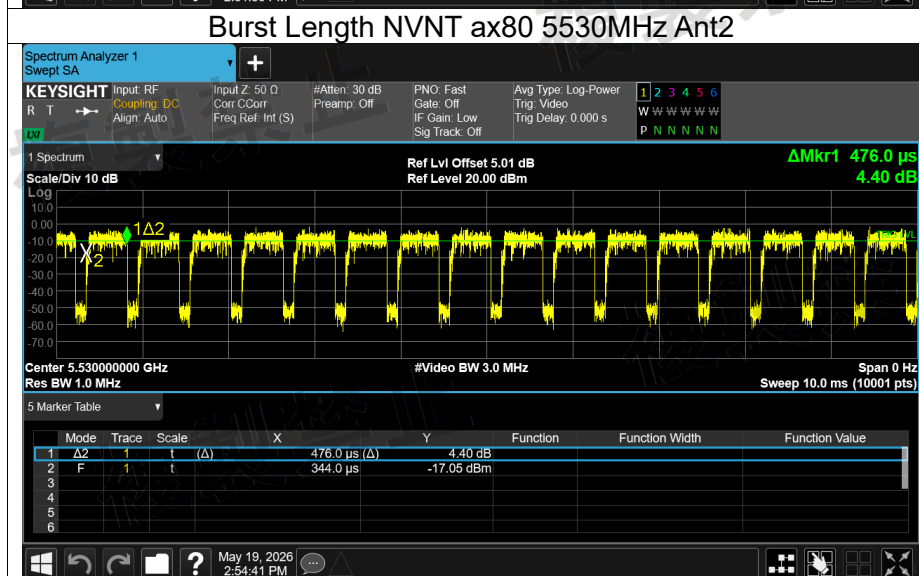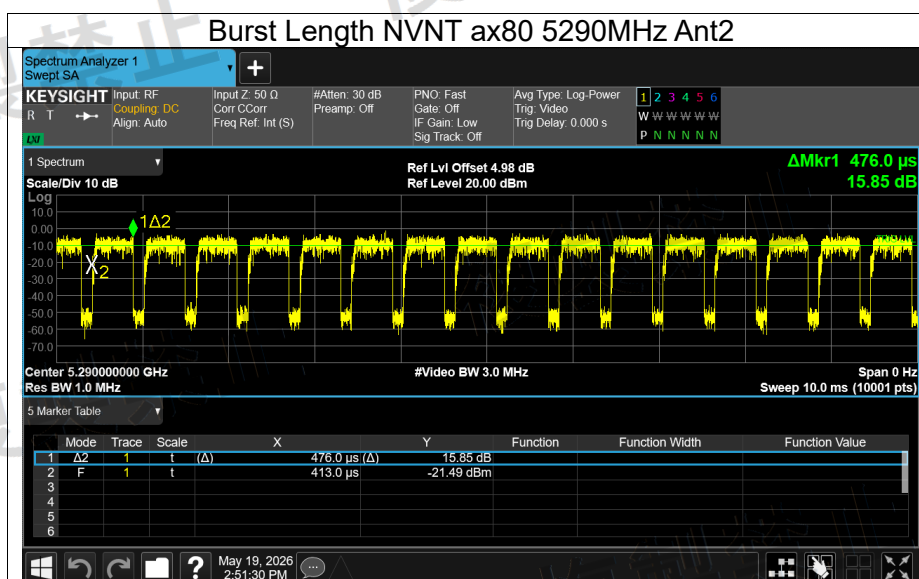

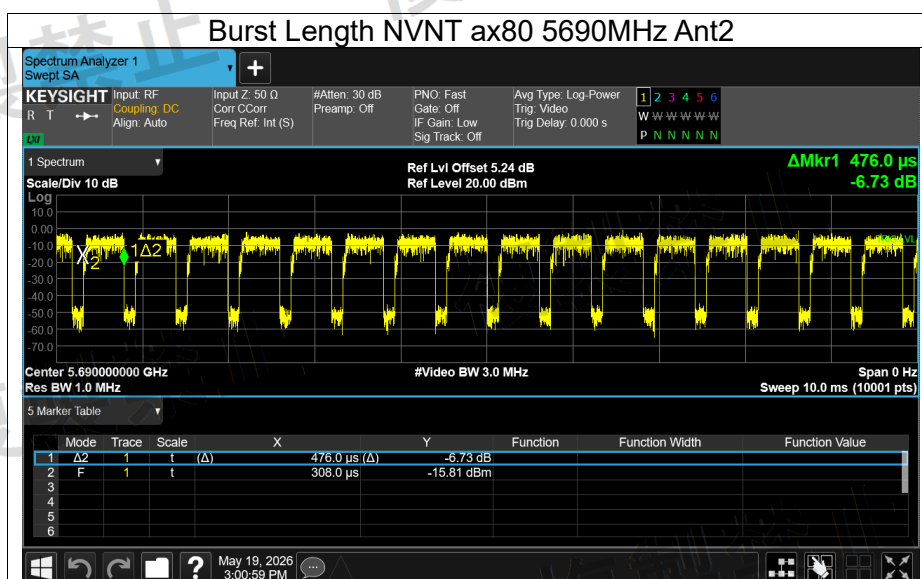



Rx Spurious Emission

Condition	Mode	Frequency (MHz)	Antenna	Range (MHz)	Emission Frequency (MHz)	Max Peak Value (dBm)	Max RMS Value (dBm)	Max Peak Value (nW)	Max RMS Value (nW)	Limit (nW)	Verdict
NVNT	a	5180	Ant1	30-1000	959.26	-90.95	NA	0.0008	NA	4	Pass
NVNT	a	5180	Ant1	1000-2600	25825.00	-68.38	NA	0.1452	NA	20	Pass
NVNT	a	5200	Ant1	30-1000	909.79	-90.78	NA	0.0008	NA	4	Pass
NVNT	a	5200	Ant1	1000-2600	25750.00	-68.21	NA	0.151	NA	20	Pass
NVNT	a	5240	Ant1	30-1000	946.65	-90.06	NA	0.001	NA	4	Pass
NVNT	a	5240	Ant1	1000-2600	25425.00	-68.07	NA	0.156	NA	20	Pass
NVNT	a	5260	Ant1	30-1000	896.21	-90.45	NA	0.0009	NA	4	Pass
NVNT	a	5260	Ant1	1000-2600	23975.00	-68.20	NA	0.1514	NA	20	Pass
NVNT	a	5300	Ant1	30-1000	780.78	-90.66	NA	0.0009	NA	4	Pass
NVNT	a	5300	Ant1	1000-2600	25800.00	-67.62	NA	0.173	NA	20	Pass
NVNT	a	5320	Ant1	30-1000	959.26	-90.36	NA	0.0009	NA	4	Pass
NVNT	a	5320	Ant1	1000-2600	25475.00	-67.85	NA	0.1641	NA	20	Pass
NVNT	a	5500	Ant1	30-1000	922.40	-90.96	NA	0.0008	NA	4	Pass
NVNT	a	5500	Ant1	1000-2600	23975.00	-67.94	NA	0.1607	NA	20	Pass
NVNT	a	5580	Ant1	30-1000	909.79	-90.18	NA	0.001	NA	4	Pass
NVNT	a	5580	Ant1	1000-2600	25775.00	-68.18	NA	0.1521	NA	20	Pass
NVNT	a	5720	Ant1	30-1000	751.68	-90.69	NA	0.0009	NA	4	Pass
NVNT	a	5720	Ant1	1000-2600	25775.00	-68.20	NA	0.1514	NA	20	Pass
NVNT	a	5180	Ant2	30-	884.57	-	NA	0.000	NA	4	Pass



				1000		90.8 6		8			
NVNT	a	5180	Ant2	1000- 2600 0	23700.00	- 67.7 2	NA	0.169	NA	20	Pass
NVNT	a	5200	Ant2	30- 1000	864.20	- 89.4 7	NA	0.001 1	NA	4	Pass
NVNT	a	5200	Ant2	1000- 2600 0	24400.00	- 66.9 4	NA	0.202 3	NA	20	Pass
NVNT	a	5240	Ant2	30- 1000	997.09	- 90.5 3	NA	0.000 9	NA	4	Pass
NVNT	a	5240	Ant2	1000- 2600 0	25850.00	- 67.6 2	NA	0.173	NA	20	Pass
NVNT	a	5260	Ant2	30- 1000	889.42	- 90.8 7	NA	0.000 8	NA	4	Pass
NVNT	a	5260	Ant2	1000- 2600 0	25825.00	- 67.6 8	NA	0.170 6	NA	20	Pass
NVNT	a	5300	Ant2	30- 1000	874.87	- 90.7 7	NA	0.000 8	NA	4	Pass
NVNT	a	5300	Ant2	1000- 2600 0	25950.00	- 67.5 9	NA	0.174 2	NA	20	Pass
NVNT	a	5320	Ant2	30- 1000	943.74	- 90.7 5	NA	0.000 8	NA	4	Pass
NVNT	a	5320	Ant2	1000- 2600 0	25825.00	- 67.5 4	NA	0.176 2	NA	20	Pass
NVNT	a	5500	Ant2	30- 1000	894.27	- 89.5 8	NA	0.001 1	NA	4	Pass
NVNT	a	5500	Ant2	1000- 2600 0	23350.00	- 67.2 8	NA	0.187 1	NA	20	Pass
NVNT	a	5580	Ant2	30- 1000	780.78	- 90.8 7	NA	0.000 8	NA	4	Pass
NVNT	a	5580	Ant2	1000- 2600 0	25750.00	- 67.3 6	NA	0.183 7	NA	20	Pass
NVNT	a	5720	Ant2	30- 1000	884.57	- 90.5 6	NA	0.000 9	NA	4	Pass
NVNT	a	5720	Ant2	1000- 2600 0	24150.00	- 67.4 8	NA	0.178 6	NA	20	Pass
NVNT	n20	5180	Ant1	30- 1000	903.97	- 90.6 7	NA	0.000 9	NA	4	Pass
NVNT	n20	5180	Ant1	1000- 2600 0	25525.00	- 67.2 6	NA	0.187 9	NA	20	Pass
NVNT	n20	5200	Ant1	30- 1000	956.35	- 90.6 5	NA	0.000 9	NA	4	Pass



NVNT	n20	5200	Ant1	1000-2600 0	25400.00	- 68.2 3	NA	0.150 3	NA	20	Pass
NVNT	n20	5240	Ant1	30-1000	876.81	- 91.2 3	NA	0.000 8	NA	4	Pass
NVNT	n20	5240	Ant1	1000-2600 0	25975.00	- 67.7 4	NA	0.168 3	NA	20	Pass
NVNT	n20	5260	Ant1	30-1000	869.05	- 90.7 5	NA	0.000 8	NA	4	Pass
NVNT	n20	5260	Ant1	1000-2600 0	25750.00	- 68.3 7	NA	0.145 5	NA	20	Pass
NVNT	n20	5300	Ant1	30-1000	894.27	- 90.3 5	NA	0.000 9	NA	4	Pass
NVNT	n20	5300	Ant1	1000-2600 0	23625.00	- 68.4 1	NA	0.144 2	NA	20	Pass
NVNT	n20	5320	Ant1	30-1000	876.81	- 89.1 9	NA	0.001 2	NA	4	Pass
NVNT	n20	5320	Ant1	1000-2600 0	25950.00	- 68.1 9	NA	0.151 7	NA	20	Pass
NVNT	n20	5500	Ant1	30-1000	932.10	- 90.6 7	NA	0.000 9	NA	4	Pass
NVNT	n20	5500	Ant1	1000-2600 0	24050.00	- 68.0 2	NA	0.157 8	NA	20	Pass
NVNT	n20	5580	Ant1	30-1000	816.67	- 90.11	NA	0.001	NA	4	Pass
NVNT	n20	5580	Ant1	1000-2600 0	24725.00	- 68.0 7	NA	0.156	NA	20	Pass
NVNT	n20	5720	Ant1	30-1000	967.99	- 90.1 0	NA	0.001	NA	4	Pass
NVNT	n20	5720	Ant1	1000-2600 0	25750.00	- 67.7 8	NA	0.166 7	NA	20	Pass
NVNT	n20	5180	Ant2	30-1000	981.57	- 90.3 5	NA	0.000 9	NA	4	Pass
NVNT	n20	5180	Ant2	1000-2600 0	25775.00	- 67.5 7	NA	0.175	NA	20	Pass
NVNT	n20	5200	Ant2	30-1000	857.41	- 90.7 6	NA	0.000 8	NA	4	Pass
NVNT	n20	5200	Ant2	1000-2600 0	25800.00	- 67.8 3	NA	0.164 8	NA	20	Pass
NVNT	n20	5240	Ant2	30-1000	798.24	- 90.2 2	NA	0.001	NA	4	Pass
NVNT	n20	5240	Ant2	1000-2600 0	23450.00	- 67.8 5	NA	0.164 1	NA	20	Pass



NVNT	n20	5260	Ant2	30-1000	869.05	-90.06	NA	0.001	NA	4	Pass
NVNT	n20	5260	Ant2	1000-26000	23700.00	-67.22	NA	0.1897	NA	20	Pass
NVNT	n20	5300	Ant2	30-1000	877.78	-90.82	NA	0.0008	NA	4	Pass
NVNT	n20	5300	Ant2	1000-26000	25550.00	-67.01	NA	0.1991	NA	20	Pass
NVNT	n20	5320	Ant2	30-1000	873.90	-90.75	NA	0.0008	NA	4	Pass
NVNT	n20	5320	Ant2	1000-26000	25875.00	-67.60	NA	0.1738	NA	20	Pass
NVNT	n20	5500	Ant2	30-1000	879.72	-90.62	NA	0.0009	NA	4	Pass
NVNT	n20	5500	Ant2	1000-26000	25775.00	-67.58	NA	0.1746	NA	20	Pass
NVNT	n20	5580	Ant2	30-1000	894.27	-90.60	NA	0.0009	NA	4	Pass
NVNT	n20	5580	Ant2	1000-26000	25875.00	-67.88	NA	0.1629	NA	20	Pass
NVNT	n20	5720	Ant2	30-1000	842.86	-89.94	NA	0.001	NA	4	Pass
NVNT	n20	5720	Ant2	1000-26000	23800.00	-67.28	NA	0.1871	NA	20	Pass
NVNT	n40	5190	Ant1	30-1000	807.94	-90.51	NA	0.0009	NA	4	Pass
NVNT	n40	5190	Ant1	1000-26000	25775.00	-66.64	NA	0.2168	NA	20	Pass
NVNT	n40	5230	Ant1	30-1000	917.55	-90.39	NA	0.0009	NA	4	Pass
NVNT	n40	5230	Ant1	1000-26000	23675.00	-68.43	NA	0.1435	NA	20	Pass
NVNT	n40	5270	Ant1	30-1000	951.50	-90.08	NA	0.001	NA	4	Pass
NVNT	n40	5270	Ant1	1000-26000	23675.00	-67.38	NA	0.1828	NA	20	Pass
NVNT	n40	5310	Ant1	30-1000	903.00	-90.23	NA	0.0009	NA	4	Pass
NVNT	n40	5310	Ant1	1000-26000	25775.00	-68.19	NA	0.1517	NA	20	Pass
NVNT	n40	5510	Ant1	30-1000	967.02	-90.5	NA	0.0009	NA	4	Pass






NVNT	n40	5510	Ant1	1000-2600 0	25800.00	6 - 68.1 2	NA	0.154 2	NA	20	Pass
NVNT	n40	5550	Ant1	30-1000	860.32	- 90.4 9	NA	0.000 9	NA	4	Pass
NVNT	n40	5550	Ant1	1000-2600 0	25825.00	- 67.9 2	NA	0.161 4	NA	20	Pass
NVNT	n40	5710	Ant1	30-1000	961.20	- 90.4 4	NA	0.000 9	NA	4	Pass
NVNT	n40	5710	Ant1	1000-2600 0	23775.00	- 67.4 8	NA	0.178 6	NA	20	Pass
NVNT	n40	5190	Ant2	30-1000	978.66	- 90.1 7	NA	0.001	NA	4	Pass
NVNT	n40	5190	Ant2	1000-2600 0	26000.00	- 67.4 0	NA	0.182	NA	20	Pass
NVNT	n40	5230	Ant2	30-1000	864.20	- 90.5 5	NA	0.000 9	NA	4	Pass
NVNT	n40	5230	Ant2	1000-2600 0	25725.00	- 67.8 8	NA	0.162 9	NA	20	Pass
NVNT	n40	5270	Ant2	30-1000	935.01	- 89.7 9	NA	0.001	NA	4	Pass
NVNT	n40	5270	Ant2	1000-2600 0	25400.00	- 67.0 8	NA	0.195 9	NA	20	Pass
NVNT	n40	5310	Ant2	30-1000	907.85	- 90.6 0	NA	0.000 9	NA	4	Pass
NVNT	n40	5310	Ant2	1000-2600 0	25750.00	- 67.5 5	NA	0.175 8	NA	20	Pass
NVNT	n40	5510	Ant2	30-1000	935.98	- 90.6 7	NA	0.000 9	NA	4	Pass
NVNT	n40	5510	Ant2	1000-2600 0	25925.00	- 67.3 5	NA	0.184 1	NA	20	Pass
NVNT	n40	5550	Ant2	30-1000	891.36	- 90.2 6	NA	0.000 9	NA	4	Pass
NVNT	n40	5550	Ant2	1000-2600 0	25725.00	- 67.3 7	NA	0.183 2	NA	20	Pass
NVNT	n40	5710	Ant2	30-1000	901.06	- 89.9 8	NA	0.001	NA	4	Pass
NVNT	n40	5710	Ant2	1000-2600 0	23625.00	- 67.5 6	NA	0.175 4	NA	20	Pass
NVNT	ac80	5210	Ant1	30-1000	791.45	- 90.2 6	NA	0.000 9	NA	4	Pass
NVNT	ac80	5210	Ant1	1000-	25925.00	-	NA	0.159	NA	20	Pass









				2600 0		67.9 7		6			
NVNT	ac80	5290	Ant1	30- 1000	882.63	- 90.3 3	NA	0.000 9	NA	4	Pass
NVNT	ac80	5290	Ant1	1000- 2600 0	23675.00	- 67.9 4	NA	0.160 7	NA	20	Pass
NVNT	ac80	5530	Ant1	30- 1000	864.20	- 90.4 1	NA	0.000 9	NA	4	Pass
NVNT	ac80	5530	Ant1	1000- 2600 0	24125.00	- 67.5 2	NA	0.177	NA	20	Pass
NVNT	ac80	5610	Ant1	30- 1000	683.78	- 90.9 2	NA	0.000 8	NA	4	Pass
NVNT	ac80	5610	Ant1	1000- 2600 0	25825.00	- 68.2 9	NA	0.148 3	NA	20	Pass
NVNT	ac80	5690	Ant1	30- 1000	976.72	- 91.1 9	NA	0.000 8	NA	4	Pass
NVNT	ac80	5690	Ant1	1000- 2600 0	25675.00	- 68.2 5	NA	0.149 6	NA	20	Pass
NVNT	ac80	5210	Ant2	30- 1000	972.84	- 89.9 0	NA	0.001	NA	4	Pass
NVNT	ac80	5210	Ant2	1000- 2600 0	25875.00	- 68.0 0	NA	0.158 5	NA	20	Pass
NVNT	ac80	5290	Ant2	30- 1000	892.33	- 90.2 3	NA	0.000 9	NA	4	Pass
NVNT	ac80	5290	Ant2	1000- 2600 0	23575.00	- 67.3 4	NA	0.184 5	NA	20	Pass
NVNT	ac80	5530	Ant2	30- 1000	904.94	- 90.0 0	NA	0.001	NA	4	Pass
NVNT	ac80	5530	Ant2	1000- 2600 0	25675.00	- 67.9 6	NA	0.16	NA	20	Pass
NVNT	ac80	5610	Ant2	30- 1000	755.56	- 90.2 8	NA	0.000 9	NA	4	Pass
NVNT	ac80	5610	Ant2	1000- 2600 0	25775.00	- 67.7 7	NA	0.167 1	NA	20	Pass
NVNT	ac80	5690	Ant2	30- 1000	882.63	- 90.5 9	NA	0.000 9	NA	4	Pass
NVNT	ac80	5690	Ant2	1000- 2600 0	22725.00	- 67.6 8	NA	0.170 6	NA	20	Pass
NVNT	ax80	5210	Ant1	30- 1000	937.92	- 90.8 0	NA	0.000 8	NA	4	Pass
NVNT	ax80	5210	Ant1	1000- 2600 0	22725.00	- 68.1 9	NA	0.151 7	NA	20	Pass









NVNT	ax80	5290	Ant1	30-1000	857.41	-91.06	NA	0.0008	NA	4	Pass
NVNT	ax80	5290	Ant1	1000-26000	25825.00	-67.68	NA	0.1706	NA	20	Pass
NVNT	ax80	5530	Ant1	30-1000	921.43	-89.61	NA	0.0011	NA	4	Pass
NVNT	ax80	5530	Ant1	1000-26000	25550.00	-68.21	NA	0.151	NA	20	Pass
NVNT	ax80	5610	Ant1	30-1000	963.14	-90.32	NA	0.0009	NA	4	Pass
NVNT	ax80	5610	Ant1	1000-26000	25550.00	-68.30	NA	0.1479	NA	20	Pass
NVNT	ax80	5690	Ant1	30-1000	947.62	-90.16	NA	0.001	NA	4	Pass
NVNT	ax80	5690	Ant1	1000-26000	24650.00	-67.75	NA	0.1679	NA	20	Pass
NVNT	ax80	5210	Ant2	30-1000	966.05	-90.10	NA	0.001	NA	4	Pass
NVNT	ax80	5210	Ant2	1000-26000	25725.00	-67.33	NA	0.1849	NA	20	Pass
NVNT	ax80	5290	Ant2	30-1000	981.57	-90.01	NA	0.001	NA	4	Pass
NVNT	ax80	5290	Ant2	1000-26000	23800.00	-67.93	NA	0.1611	NA	20	Pass
NVNT	ax80	5530	Ant2	30-1000	902.03	-89.87	NA	0.001	NA	4	Pass
NVNT	ax80	5530	Ant2	1000-26000	23725.00	-67.29	NA	0.1866	NA	20	Pass
NVNT	ax80	5610	Ant2	30-1000	912.70	-89.58	NA	0.0011	NA	4	Pass
NVNT	ax80	5610	Ant2	1000-26000	25800.00	-66.51	NA	0.2234	NA	20	Pass
NVNT	ax80	5690	Ant2	30-1000	842.86	-90.34	NA	0.0009	NA	4	Pass
NVNT	ax80	5690	Ant2	1000-26000	25825.00	-67.68	NA	0.1706	NA	20	Pass

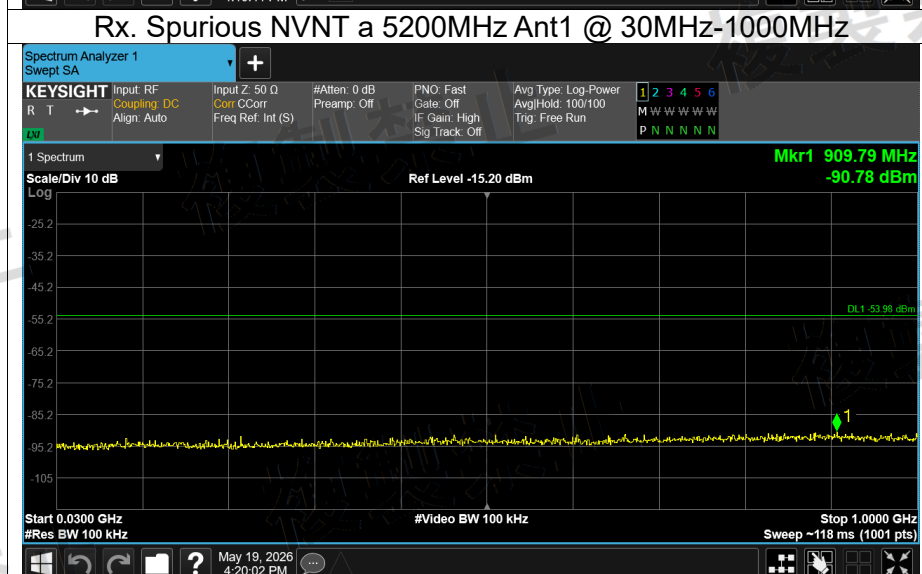
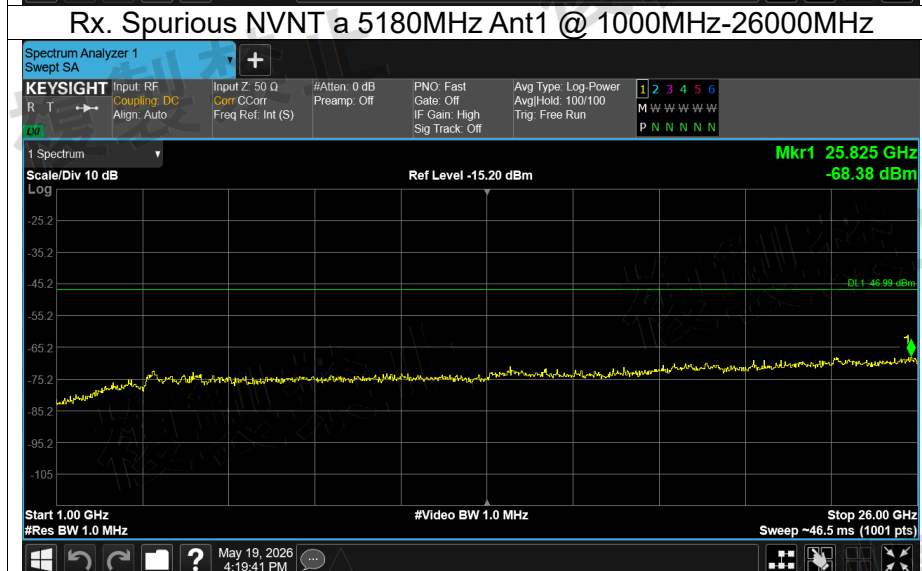
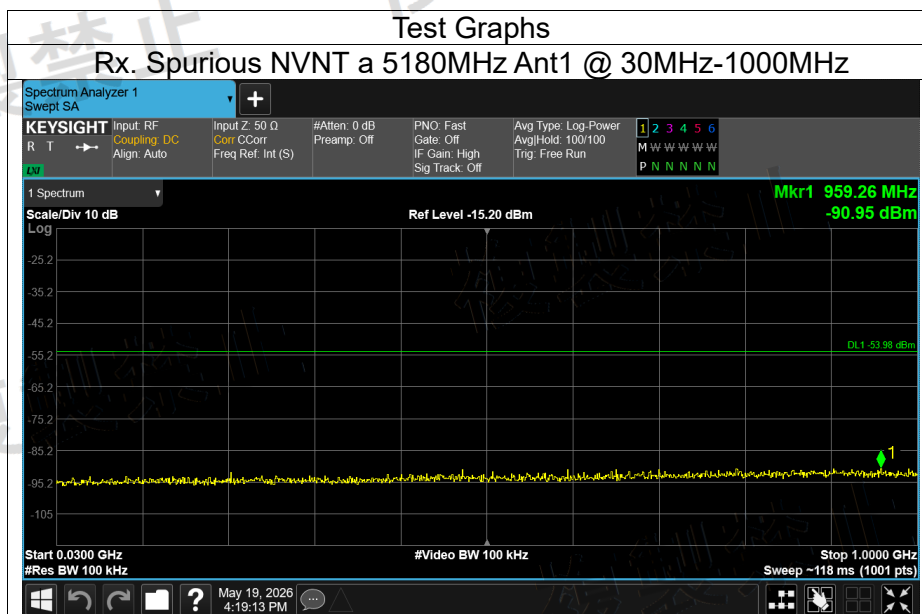


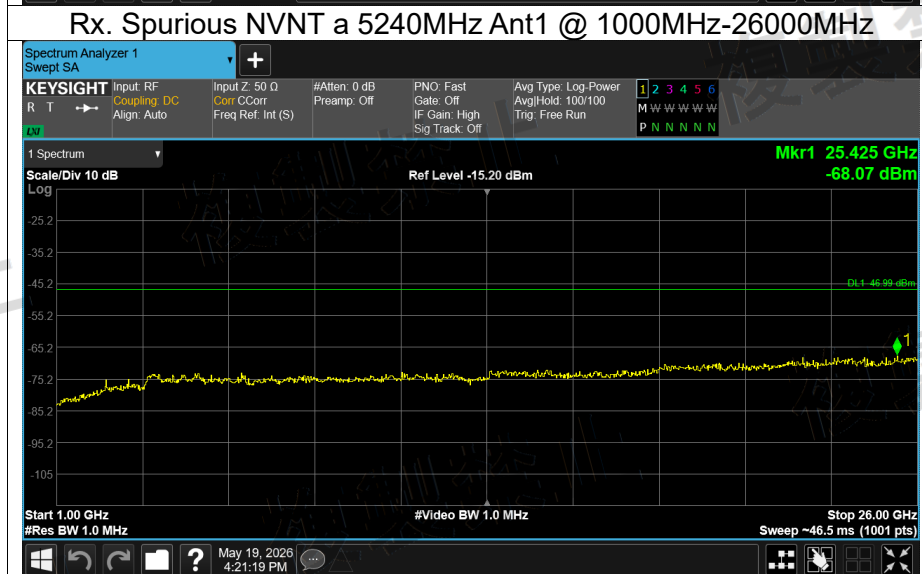
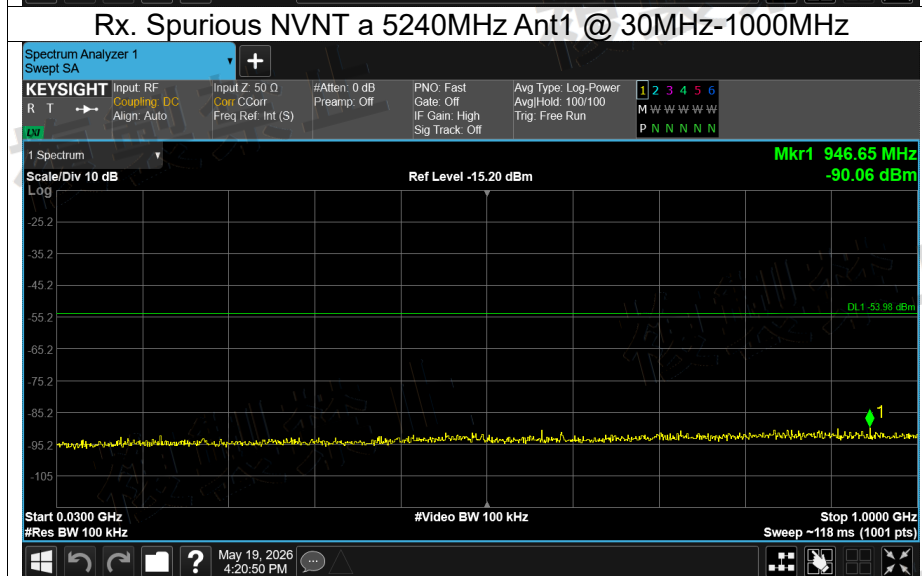
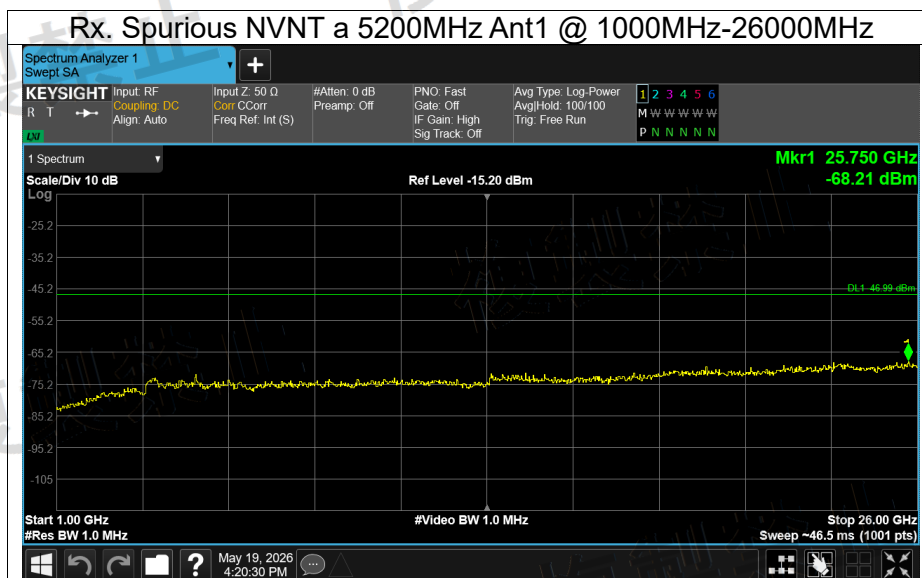


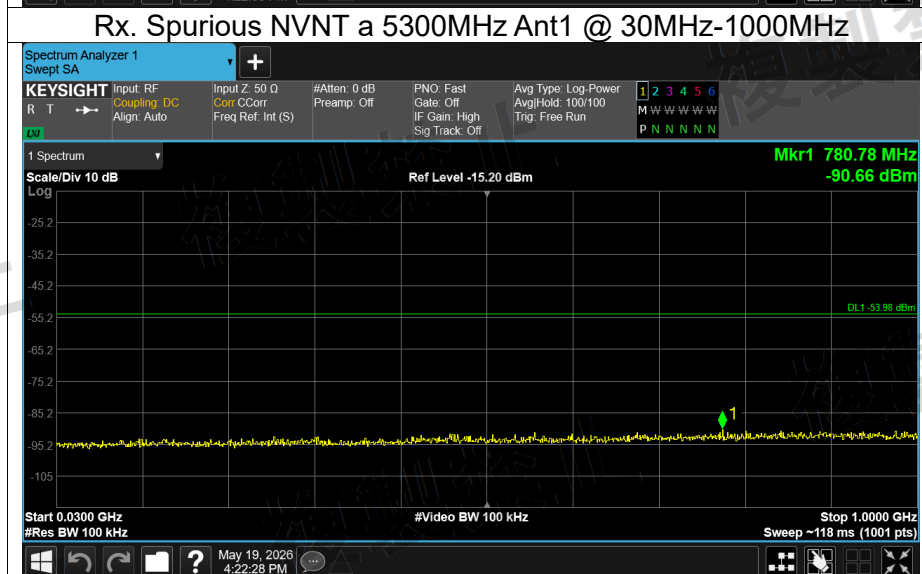
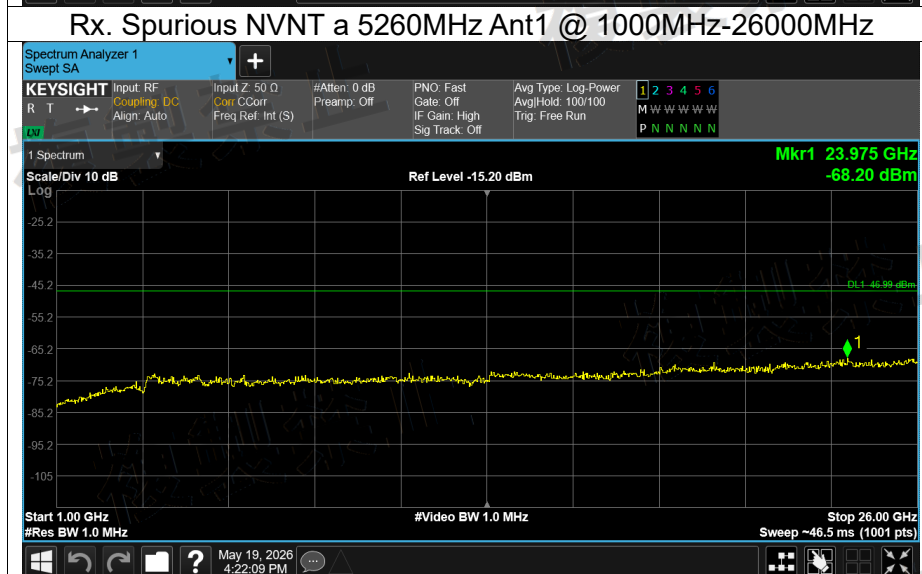
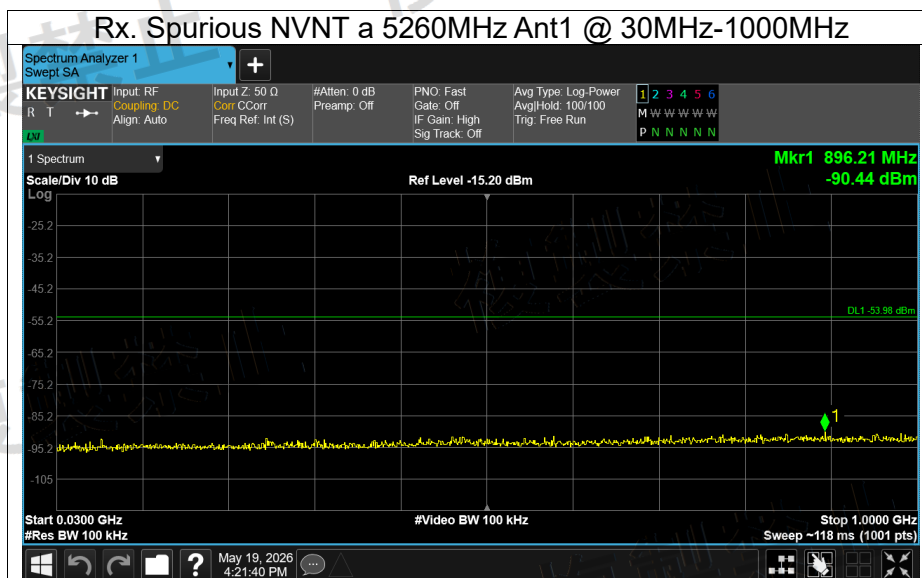


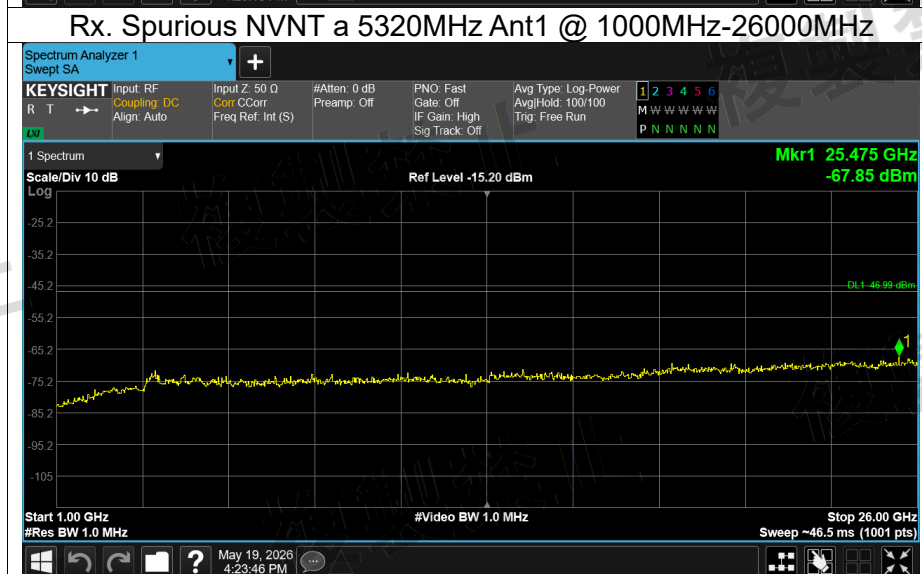
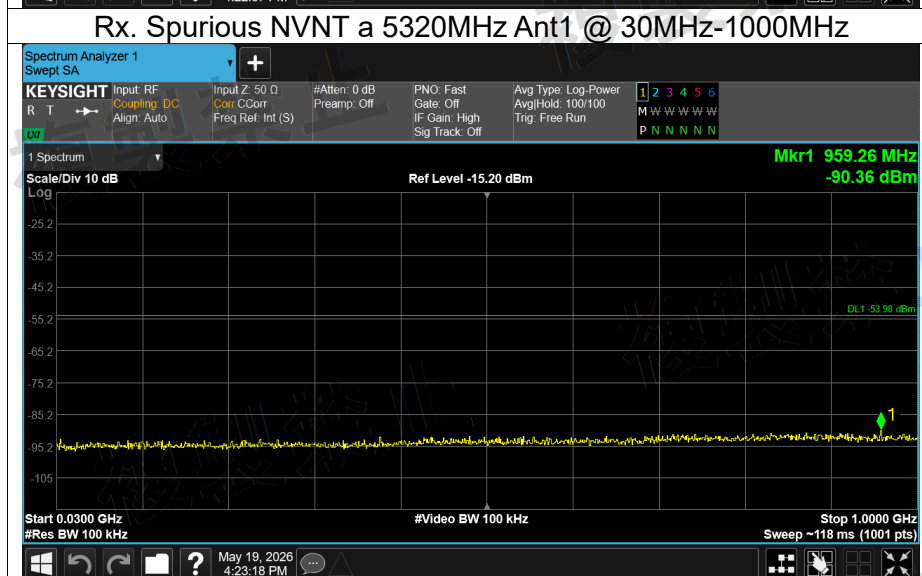
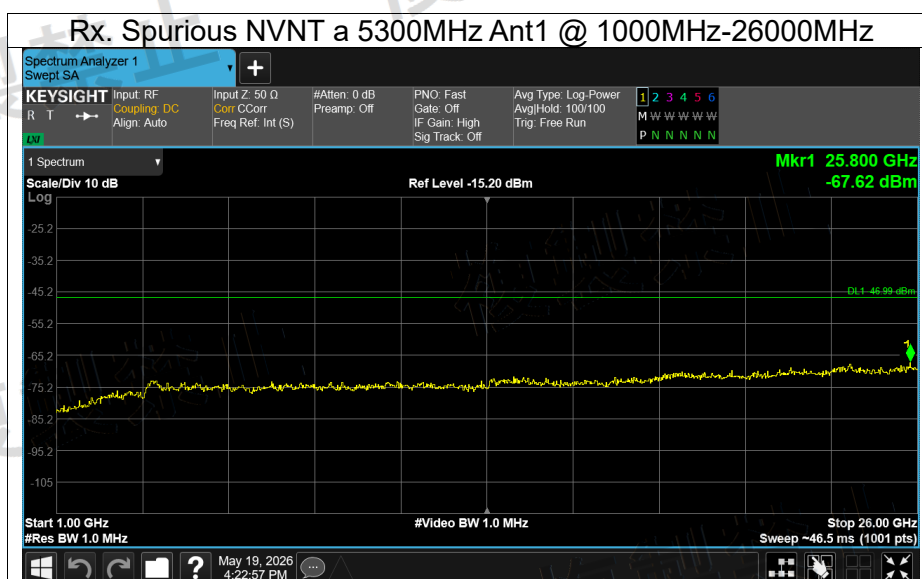


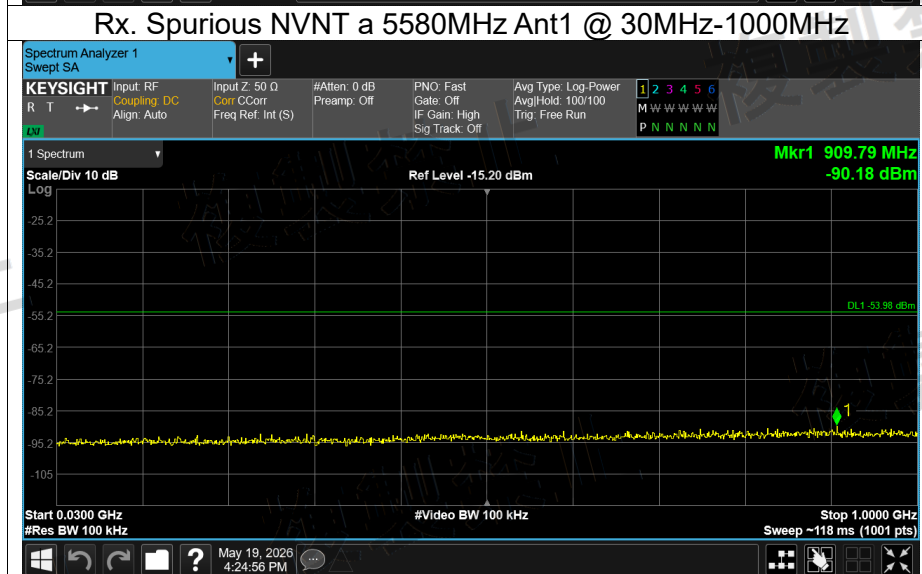
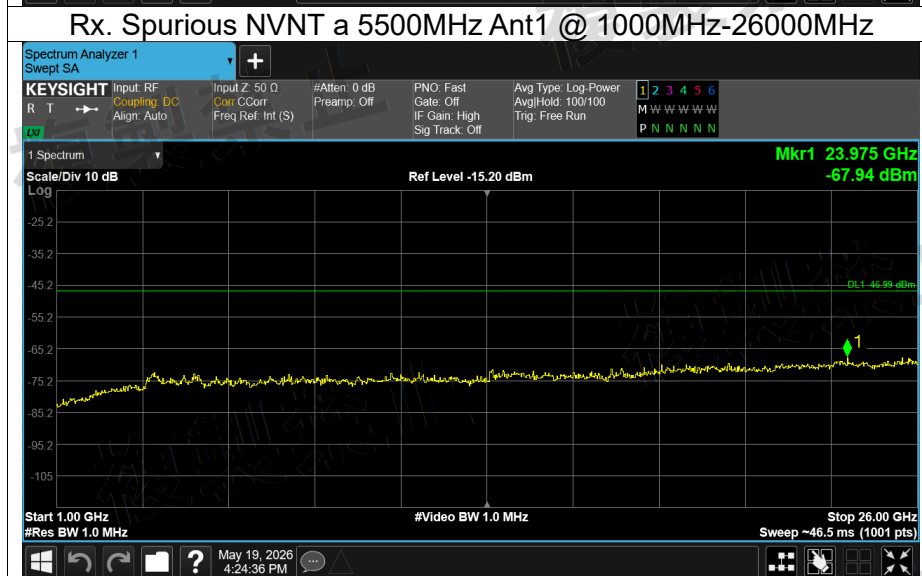
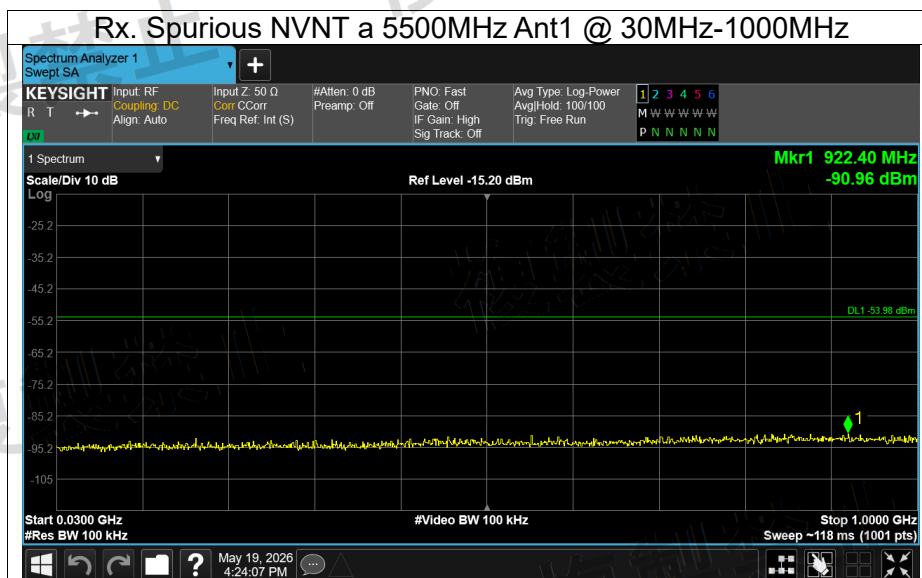


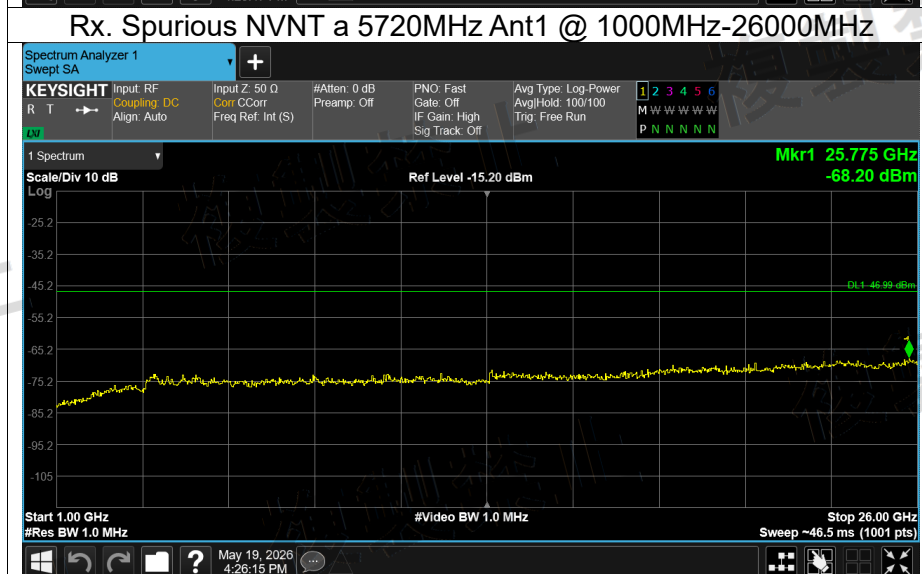
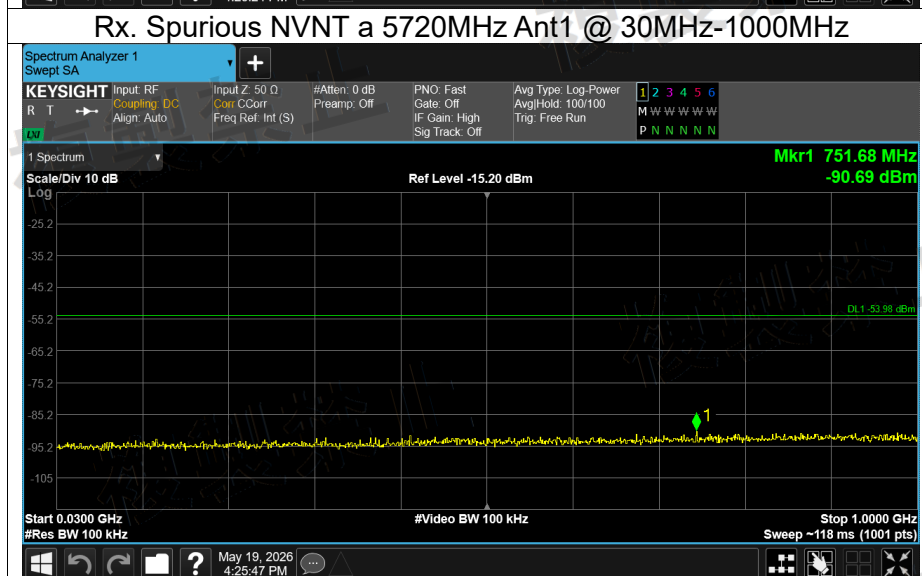
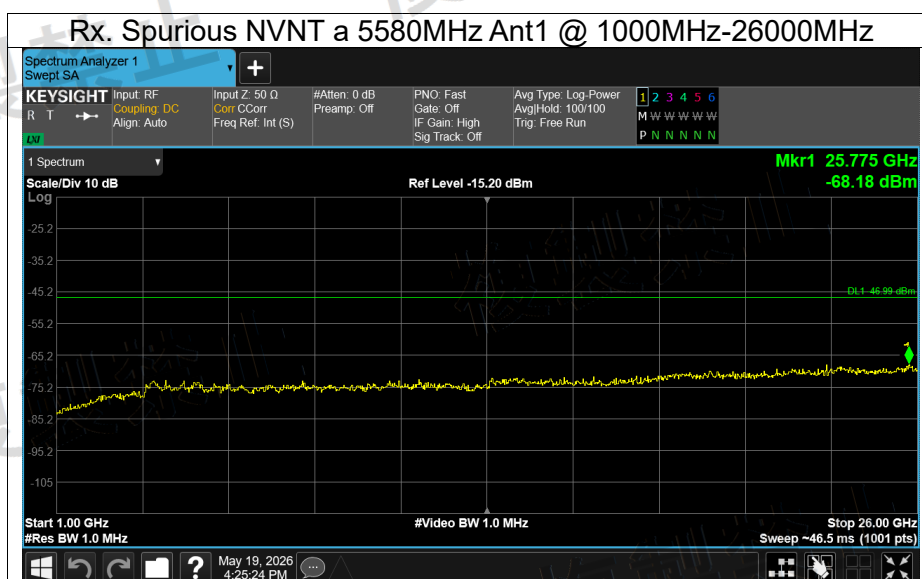


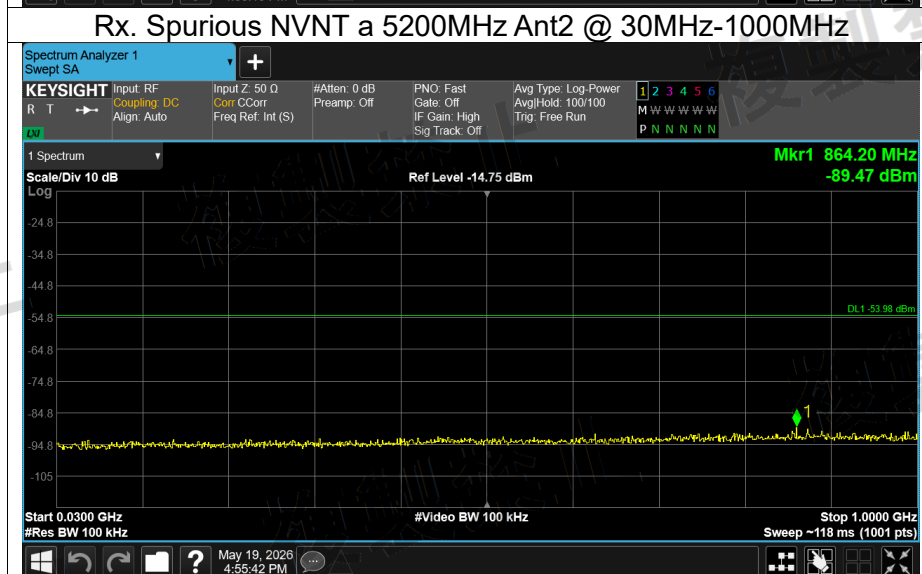
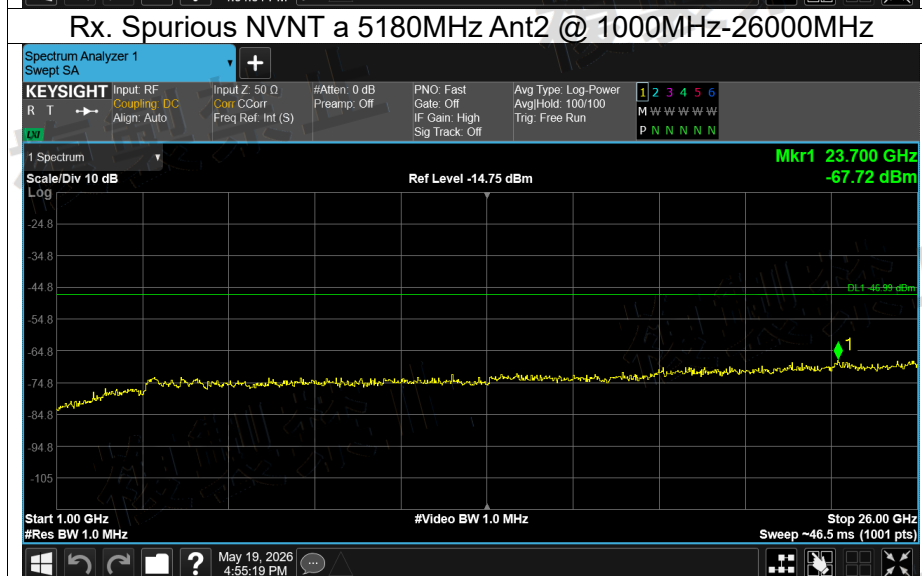
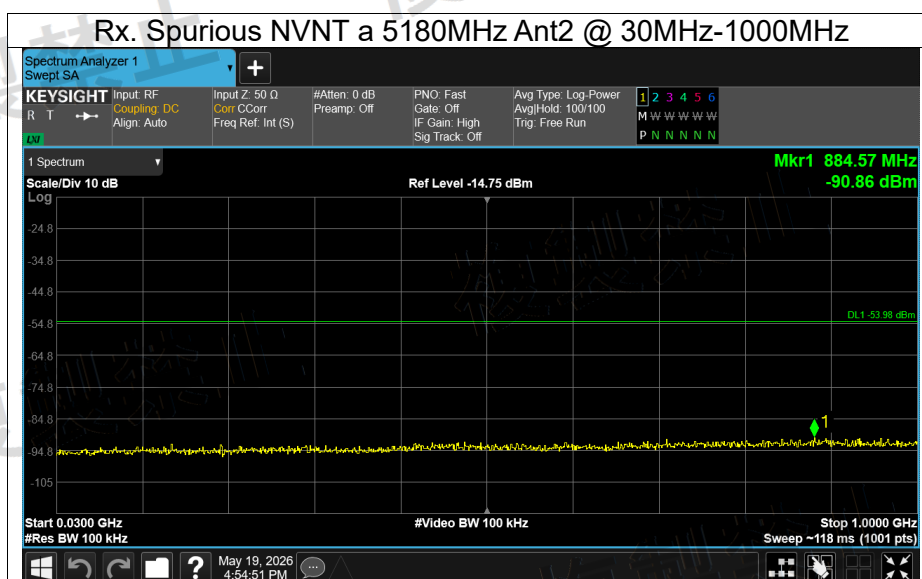


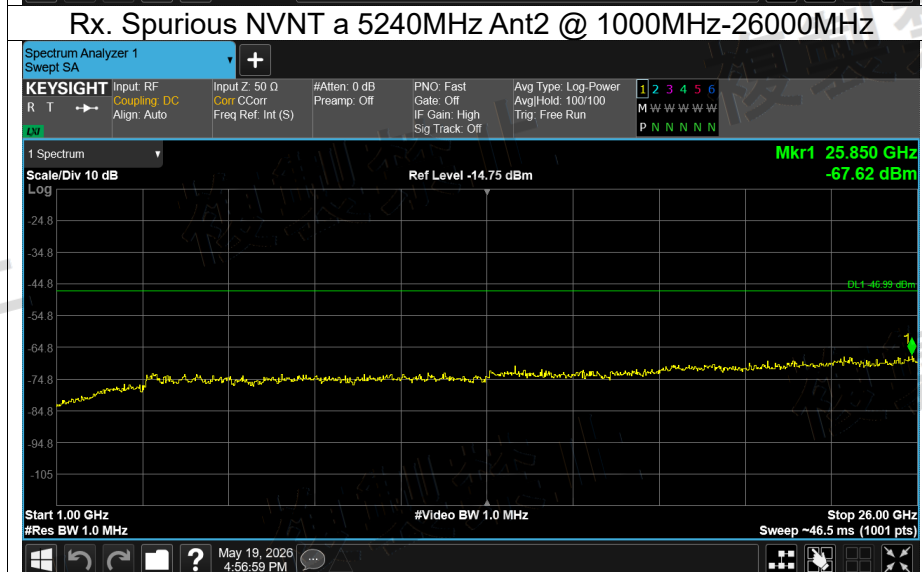
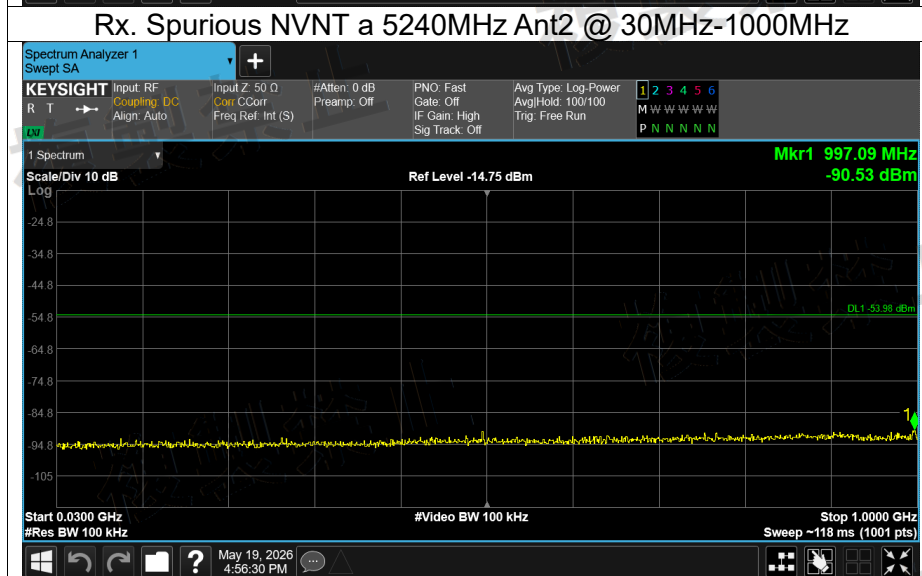
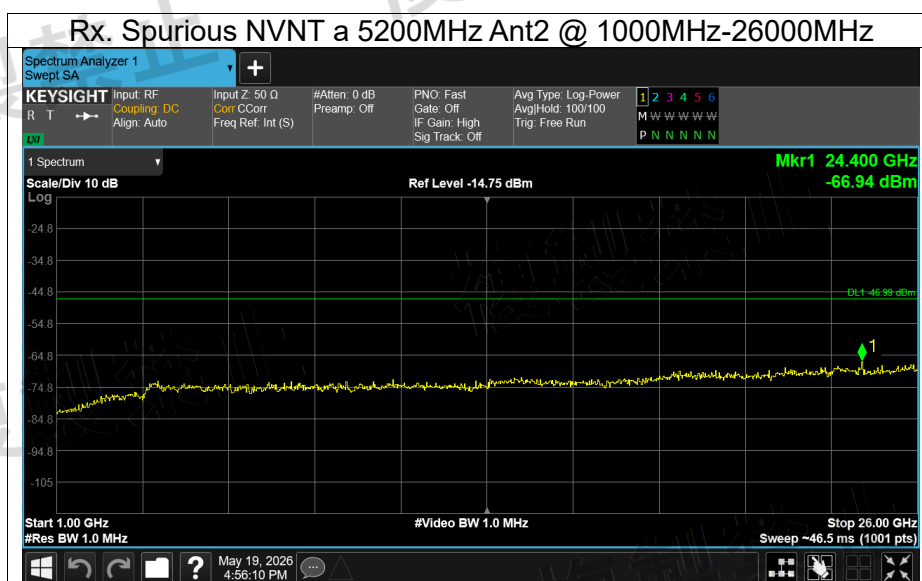


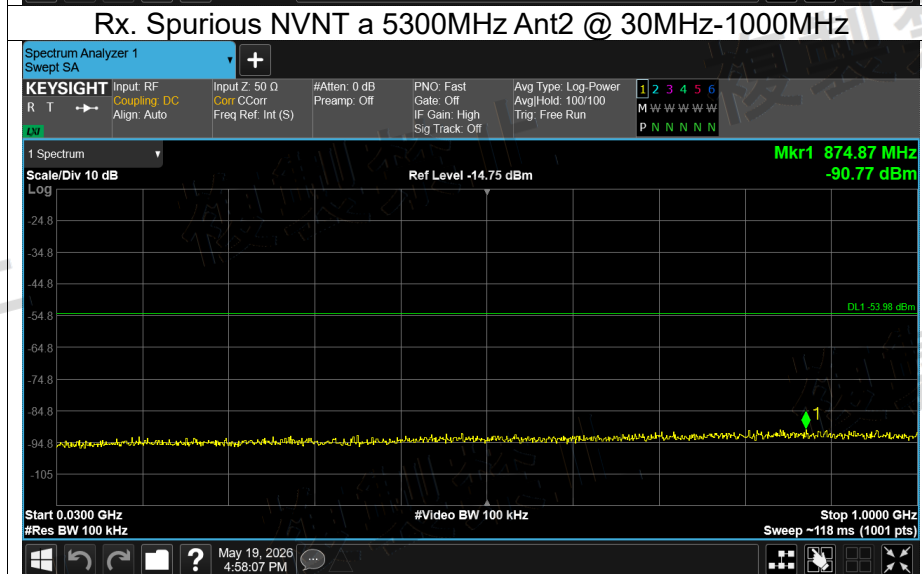
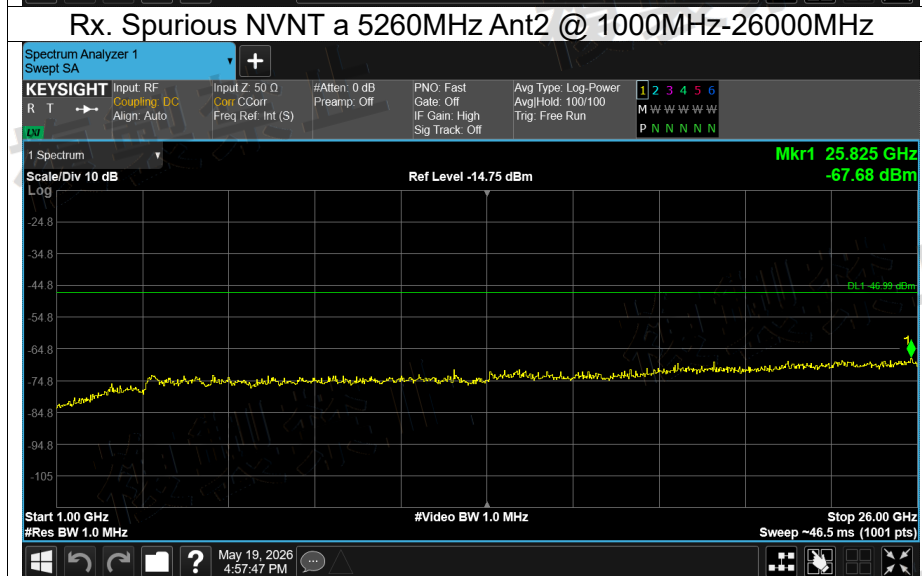
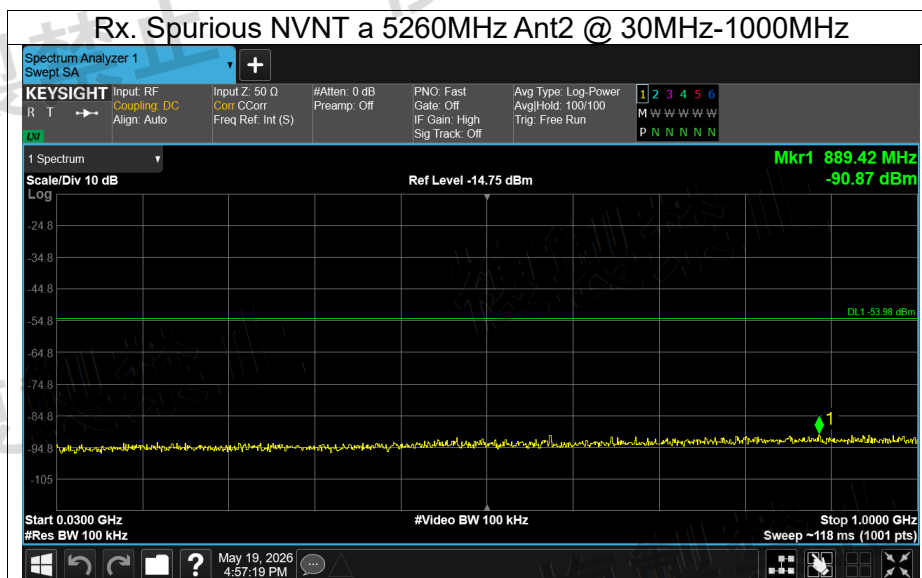


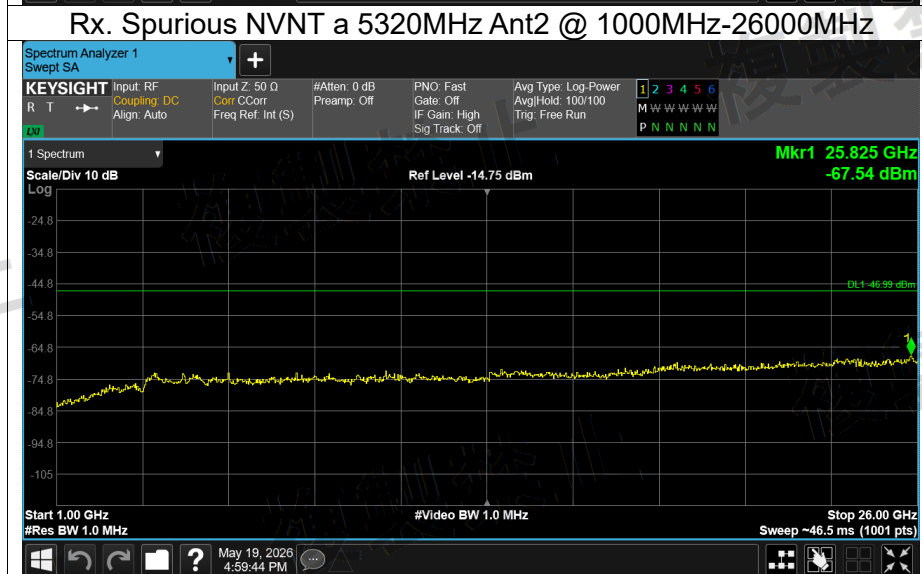
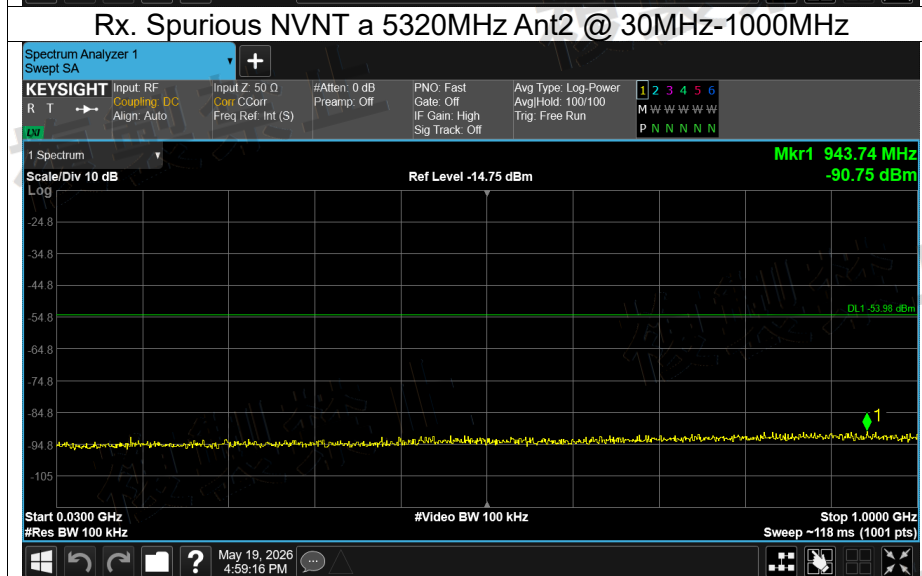
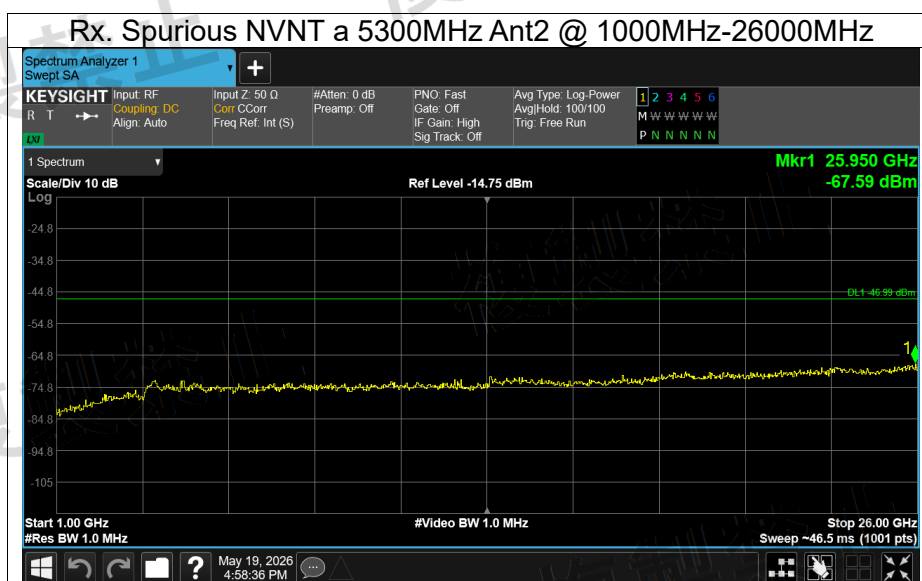


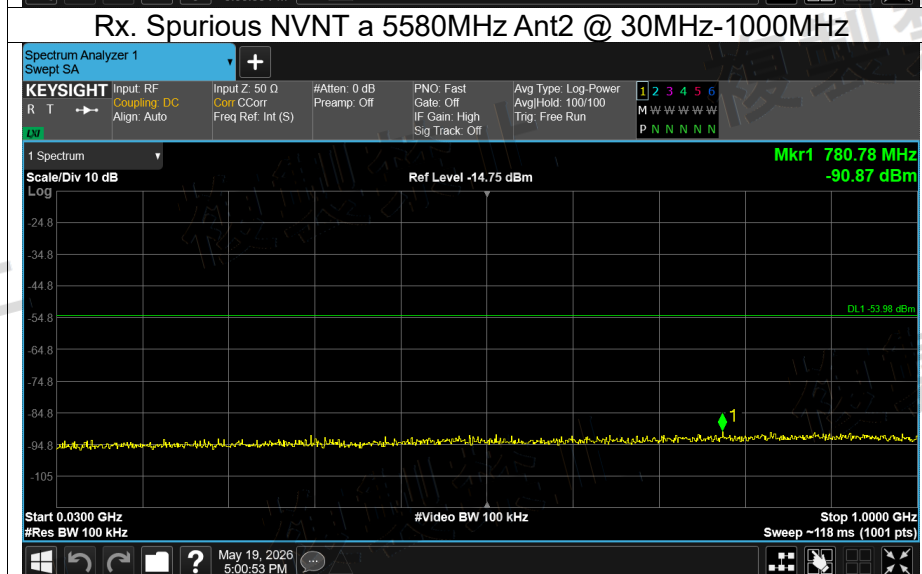
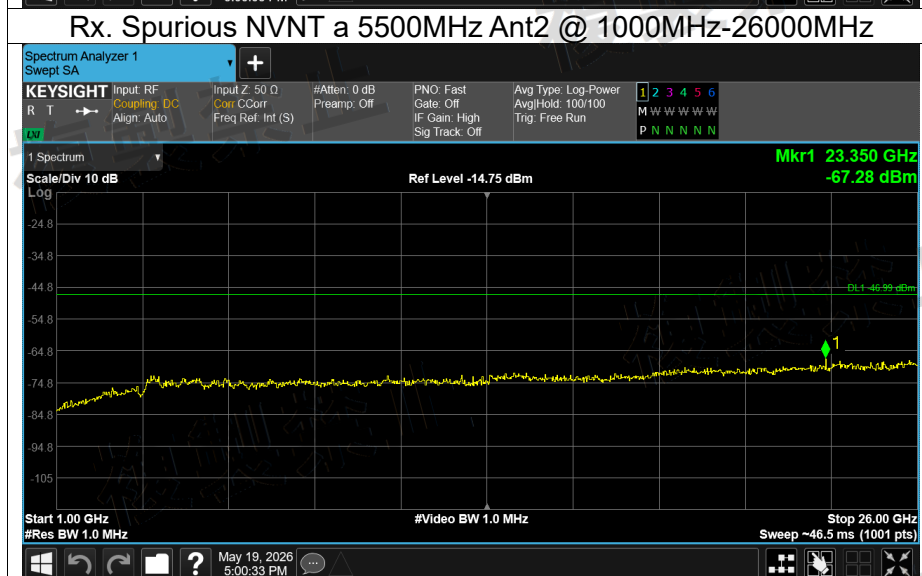
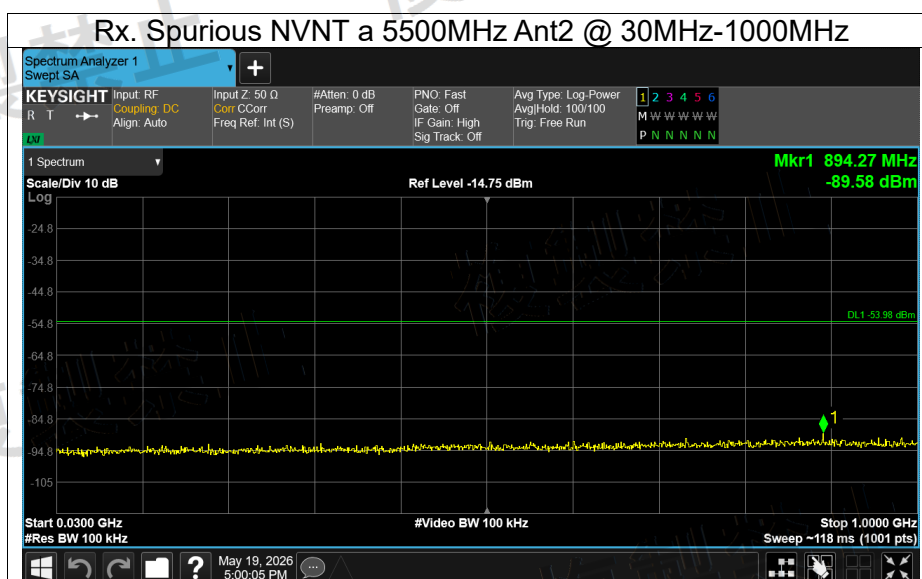


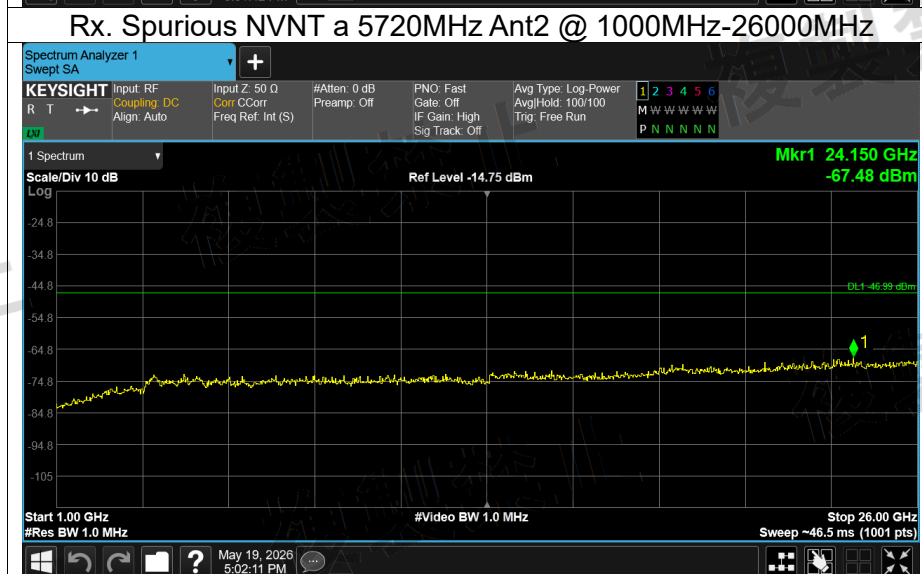
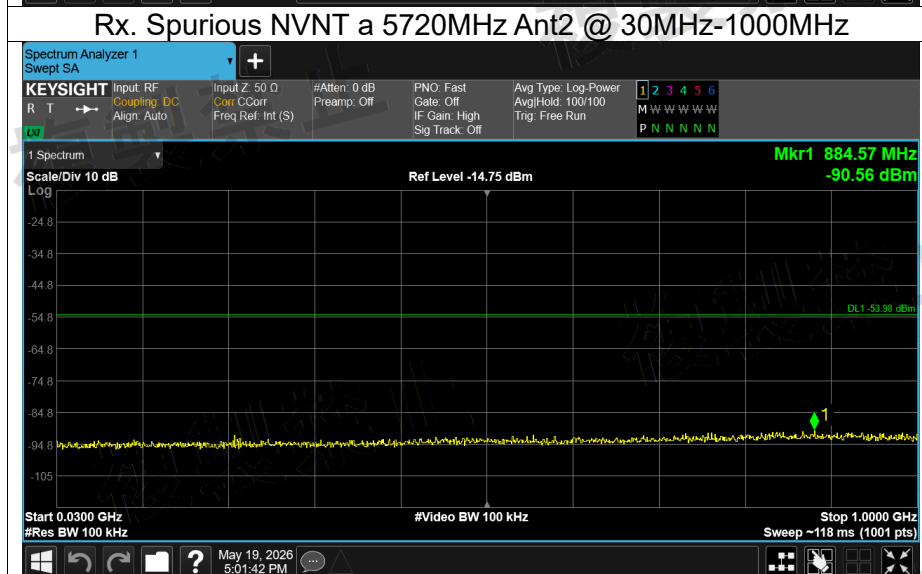
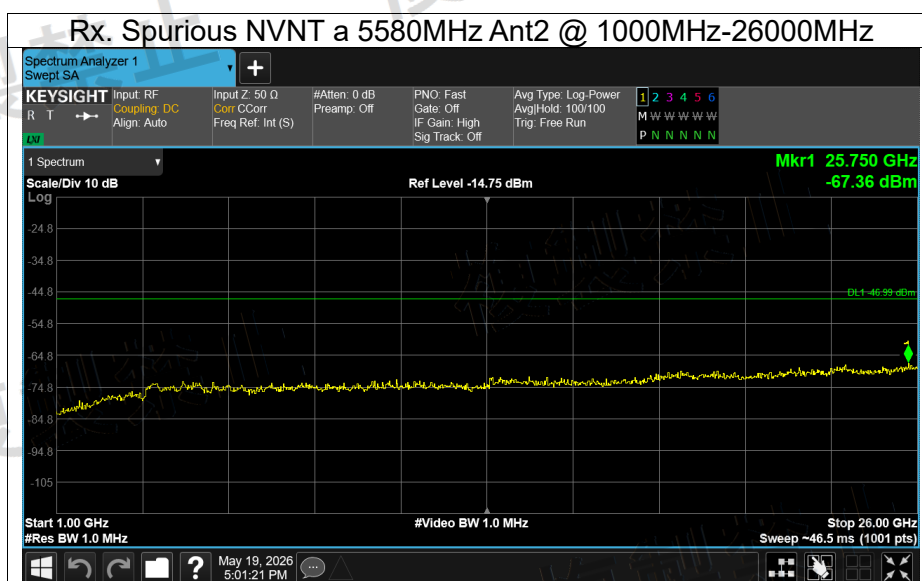


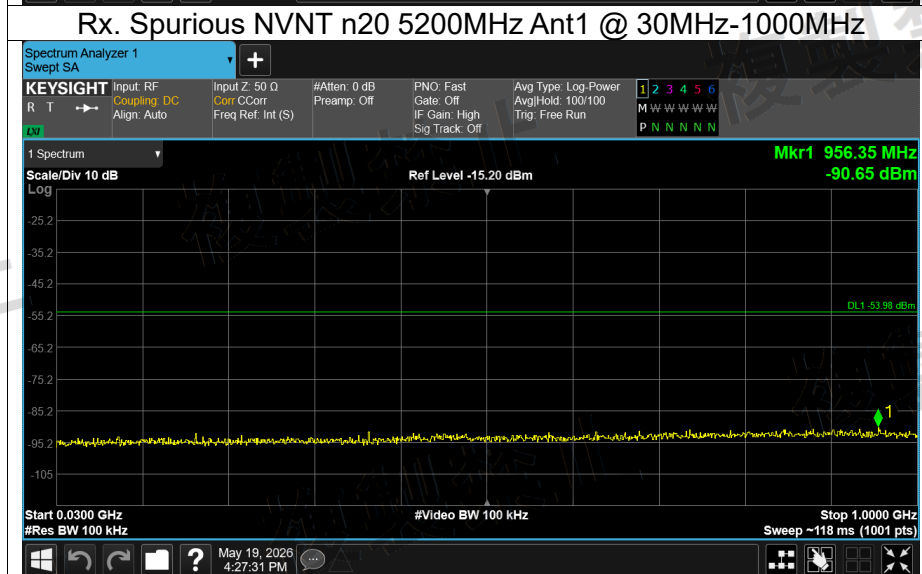
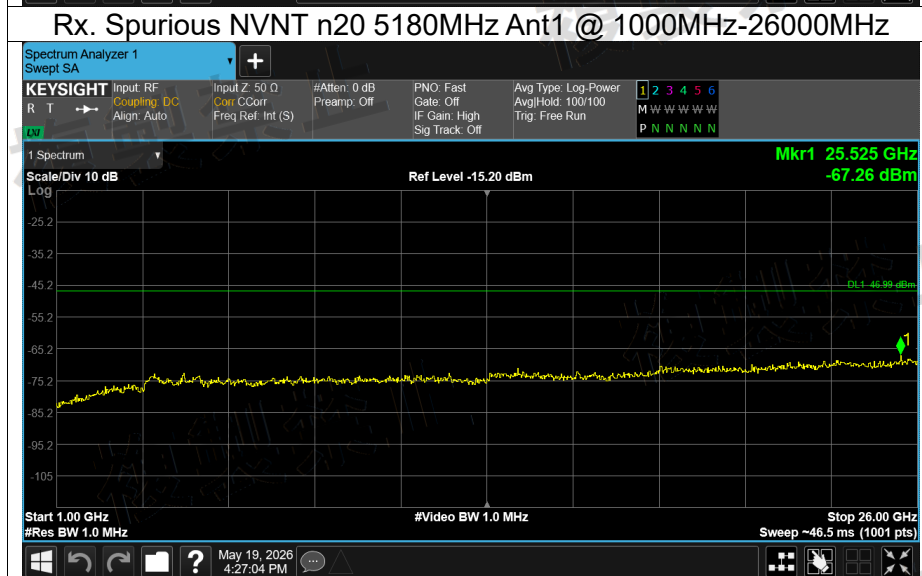
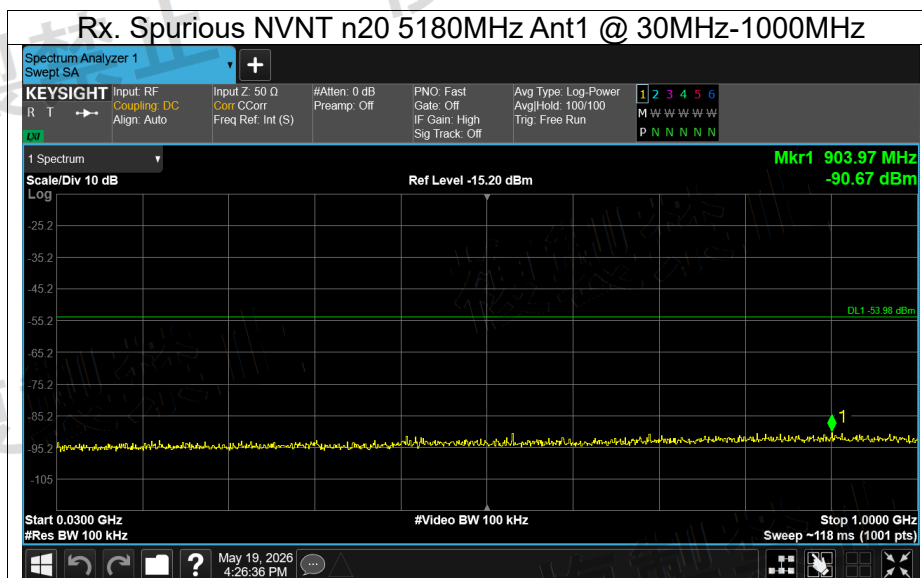


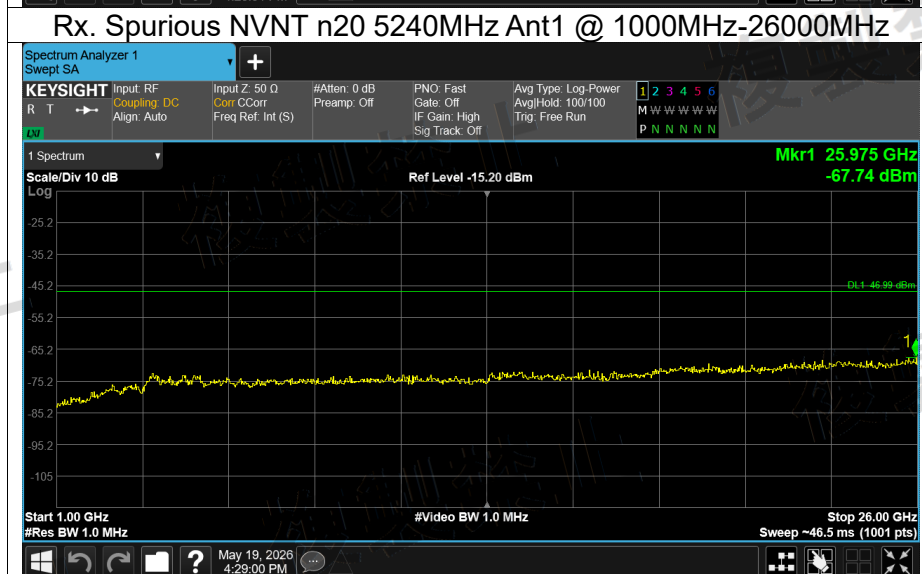
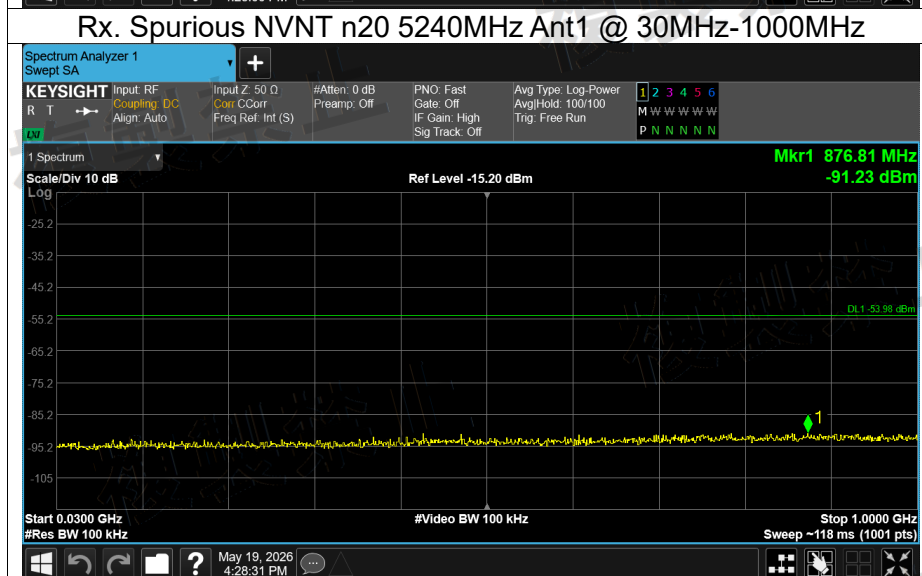
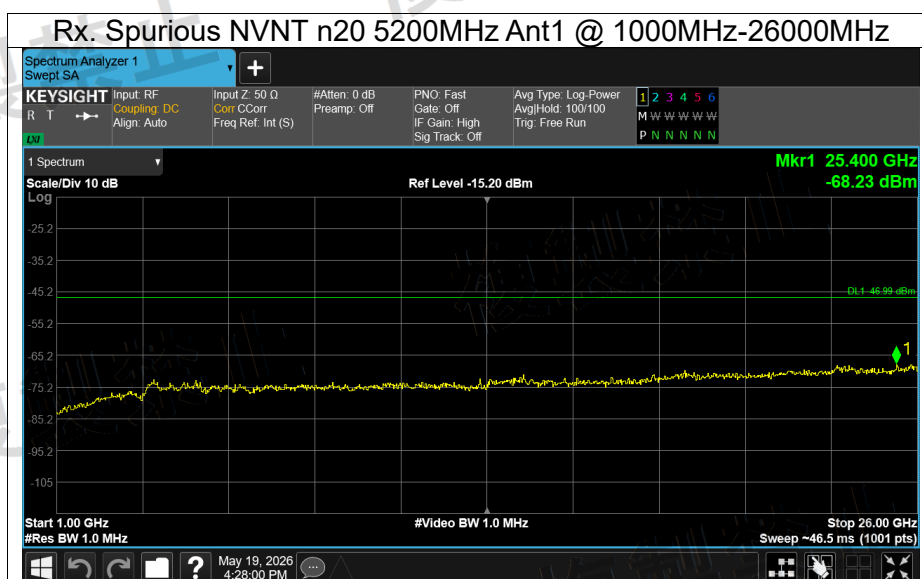


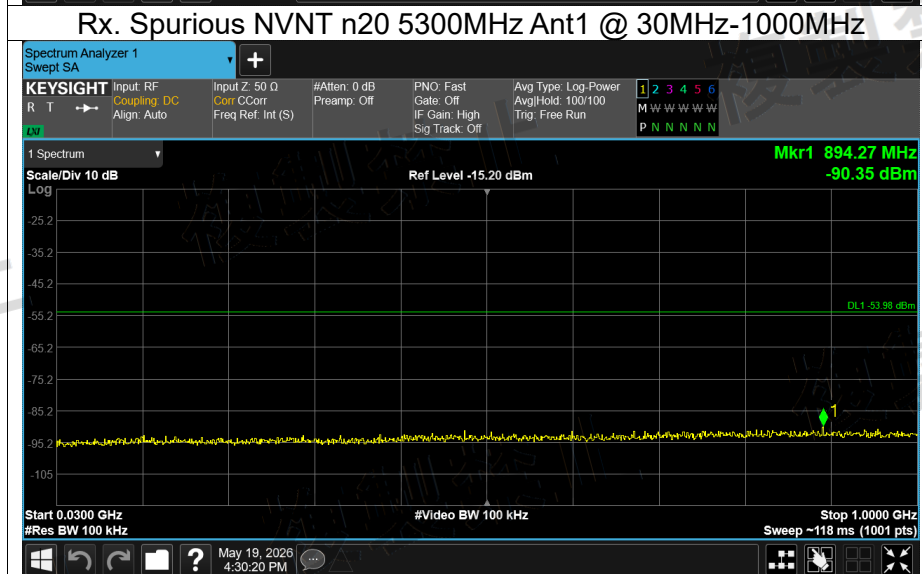
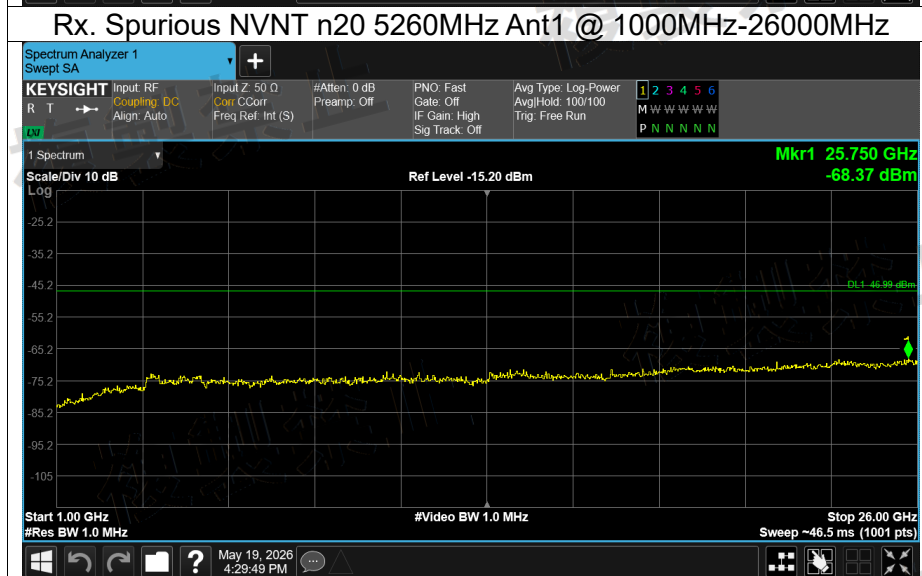
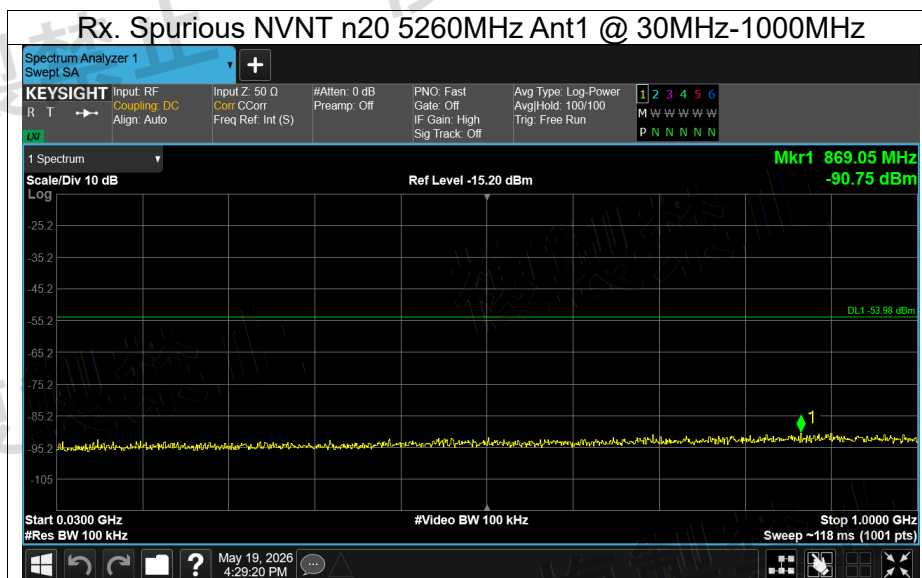


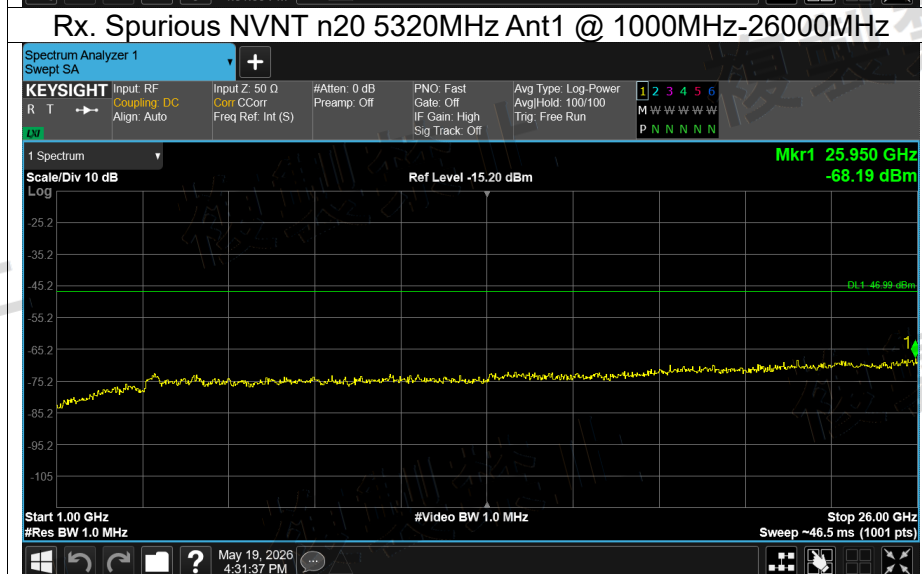
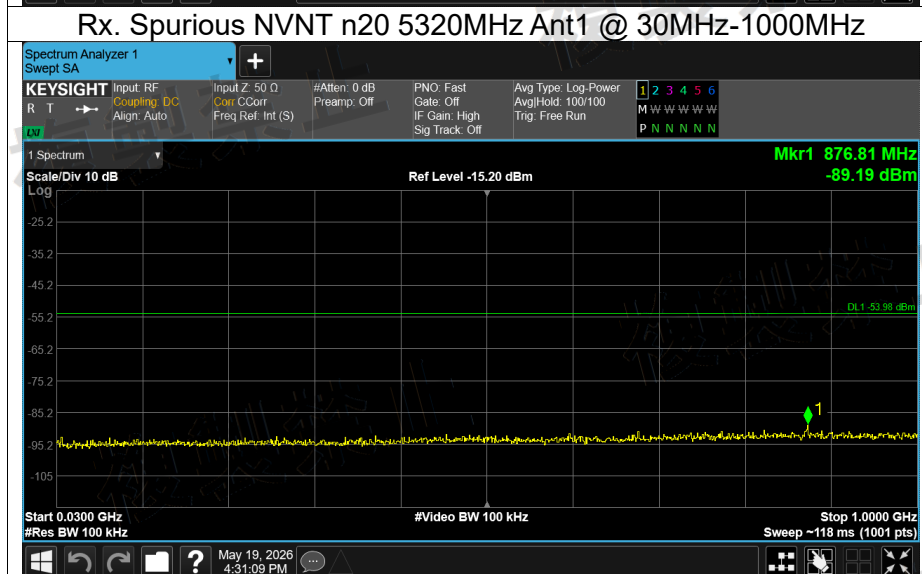
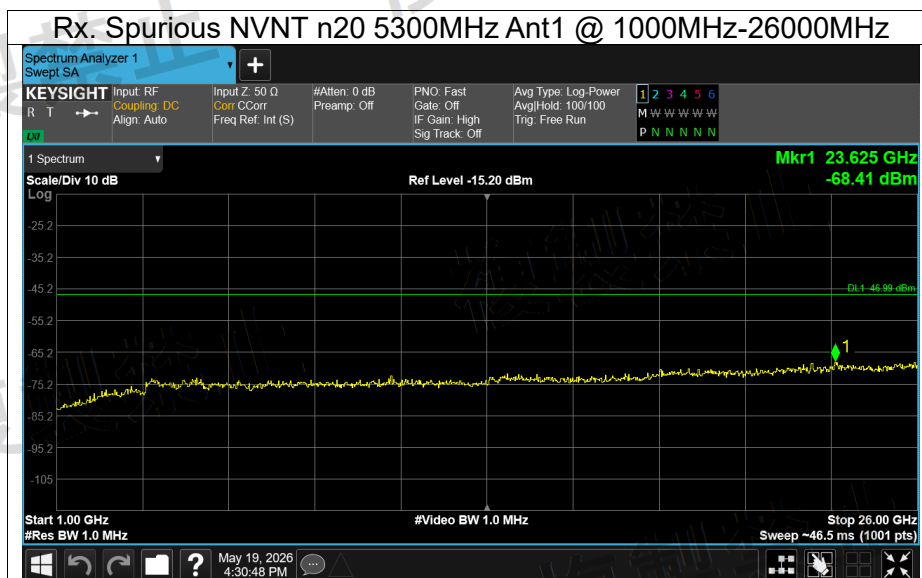


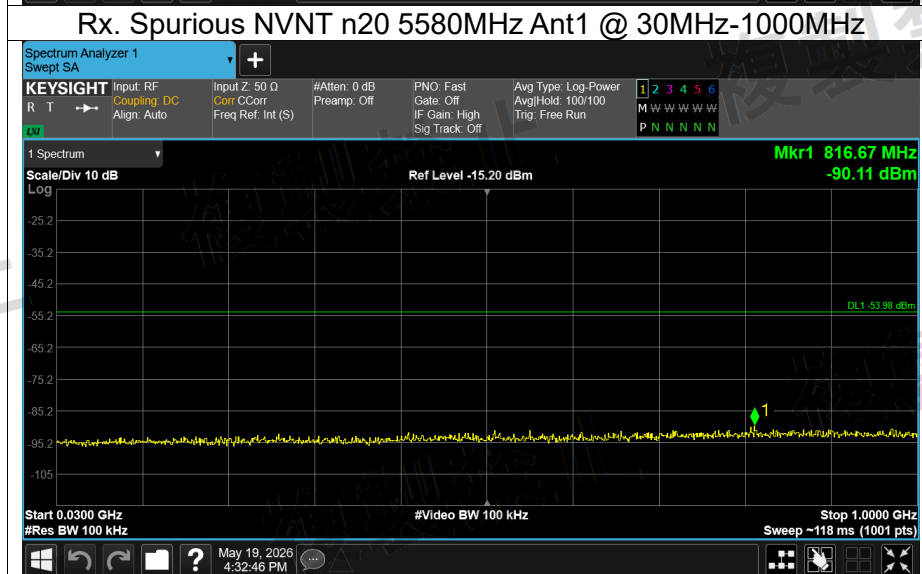
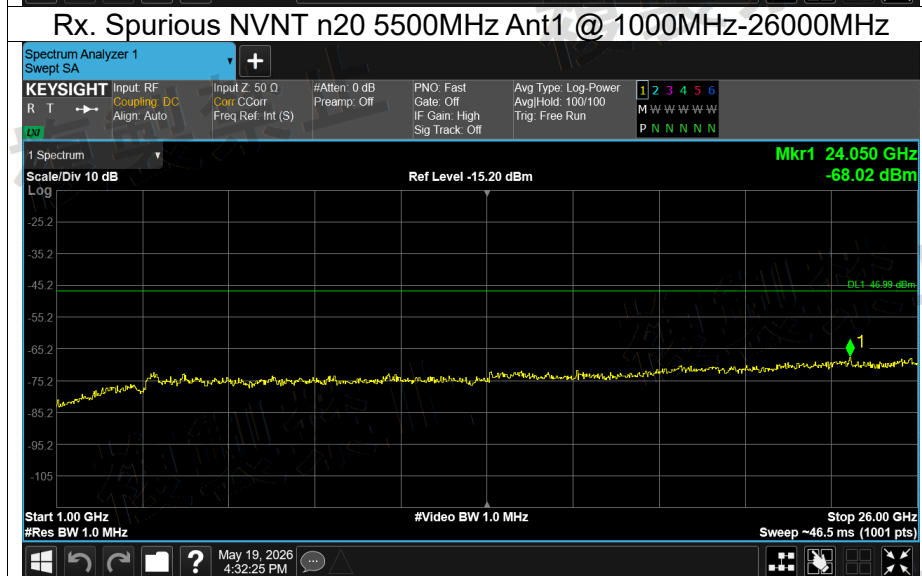
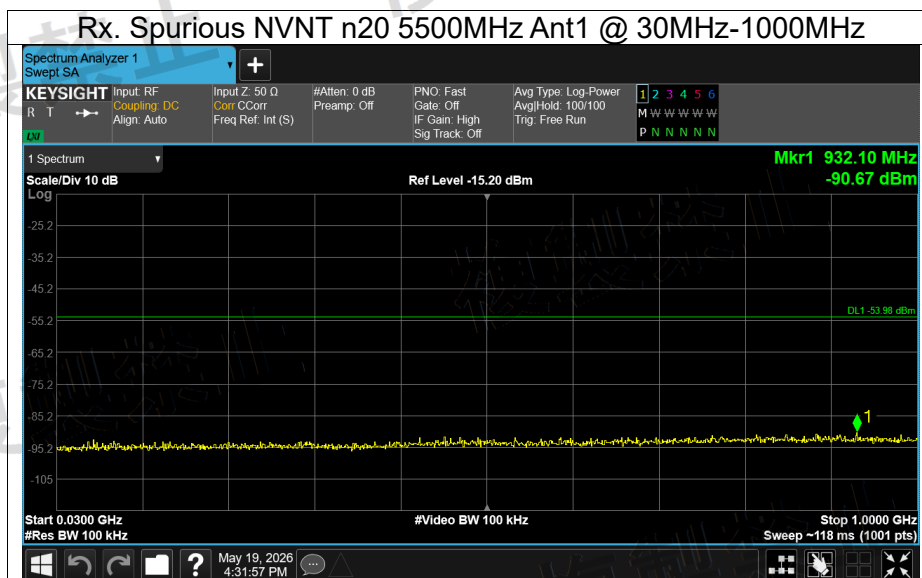


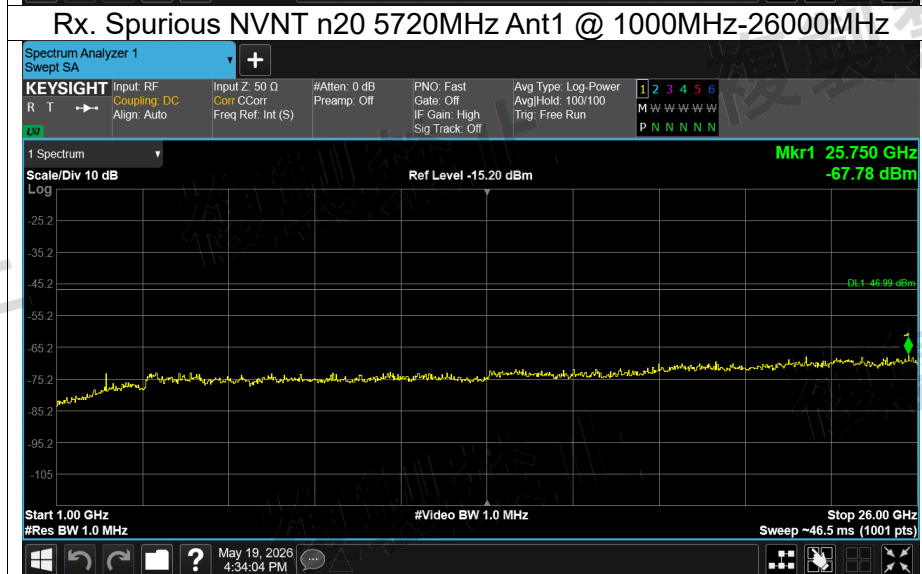
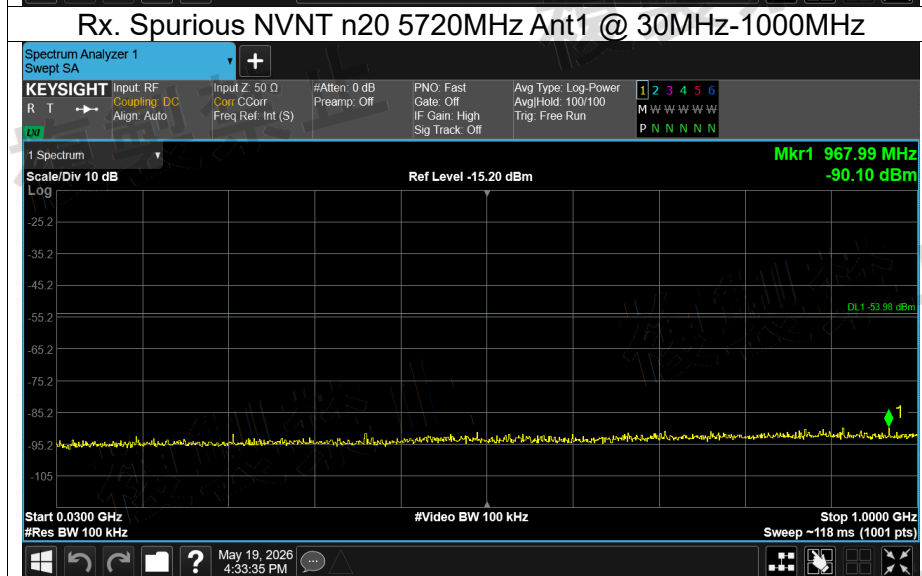
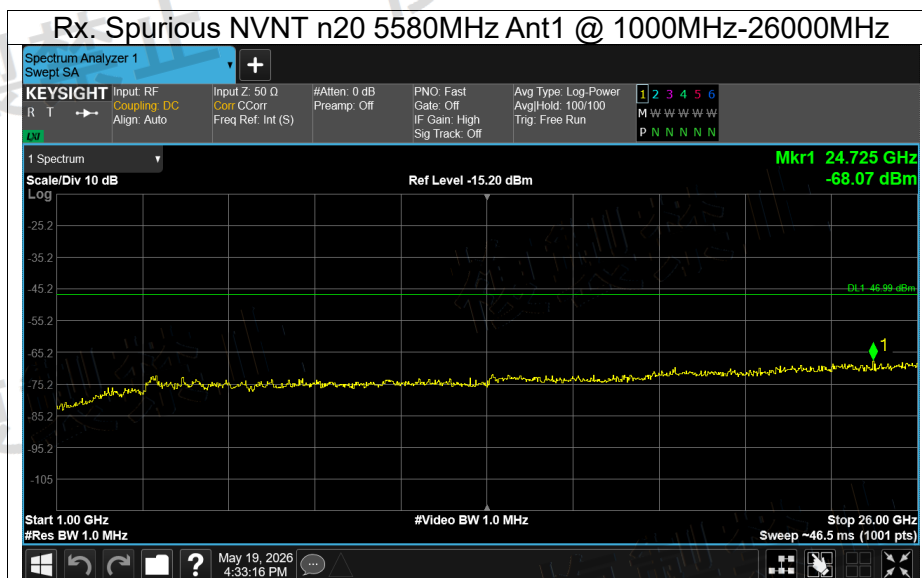


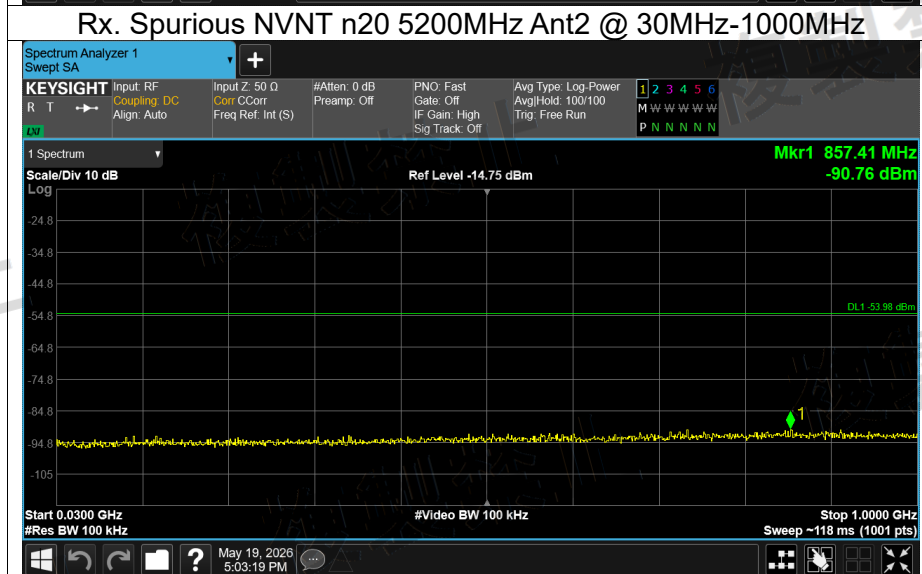
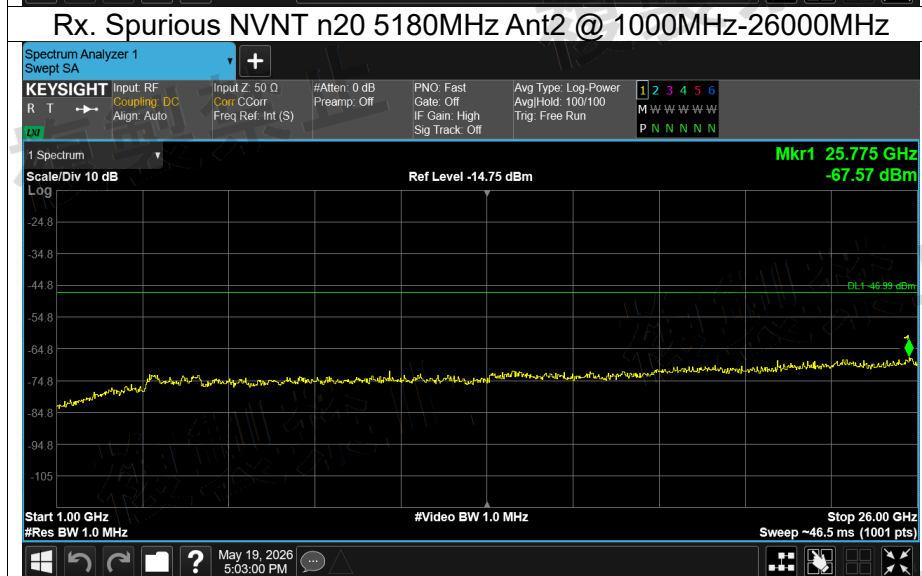
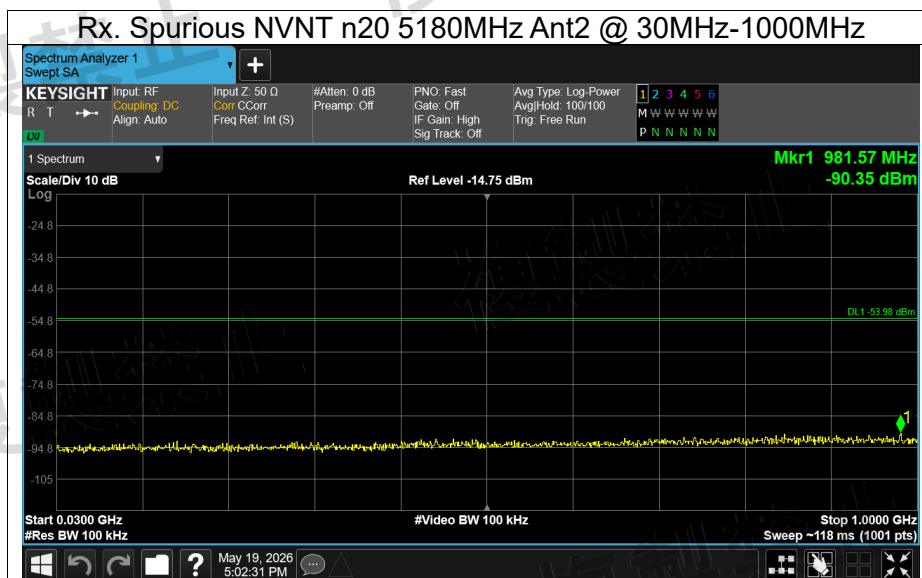


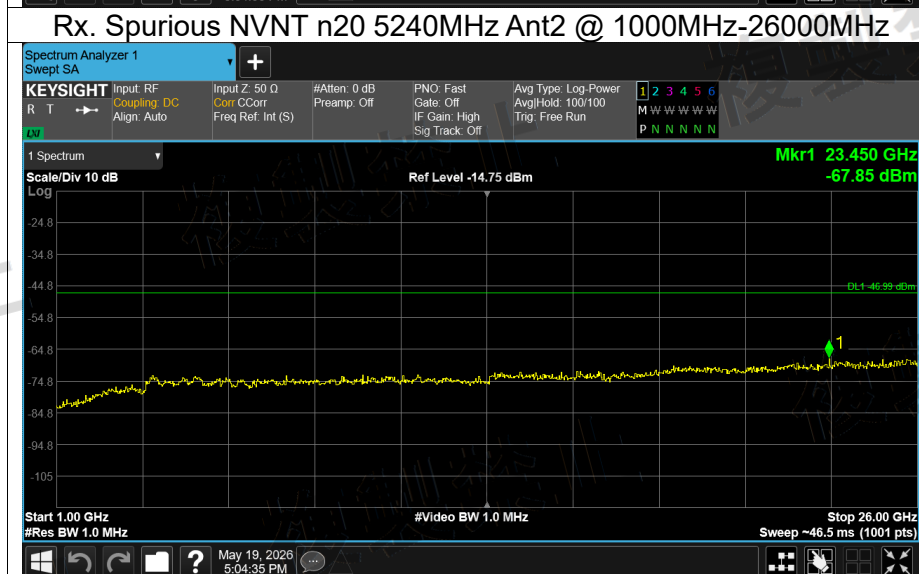
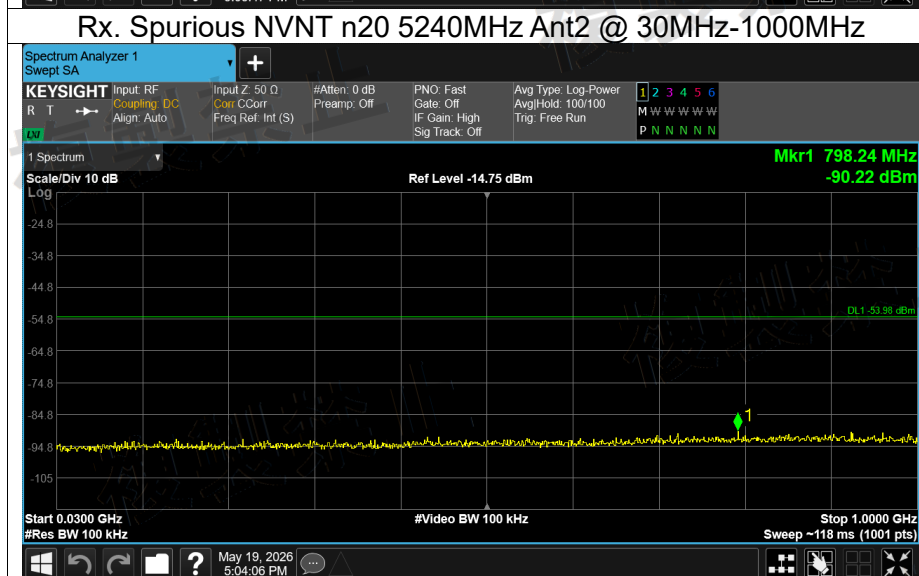
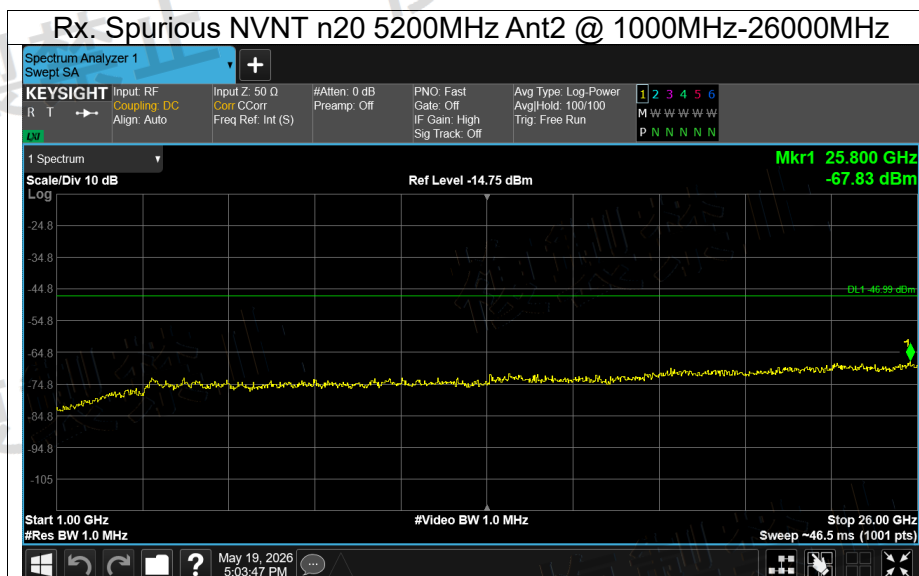


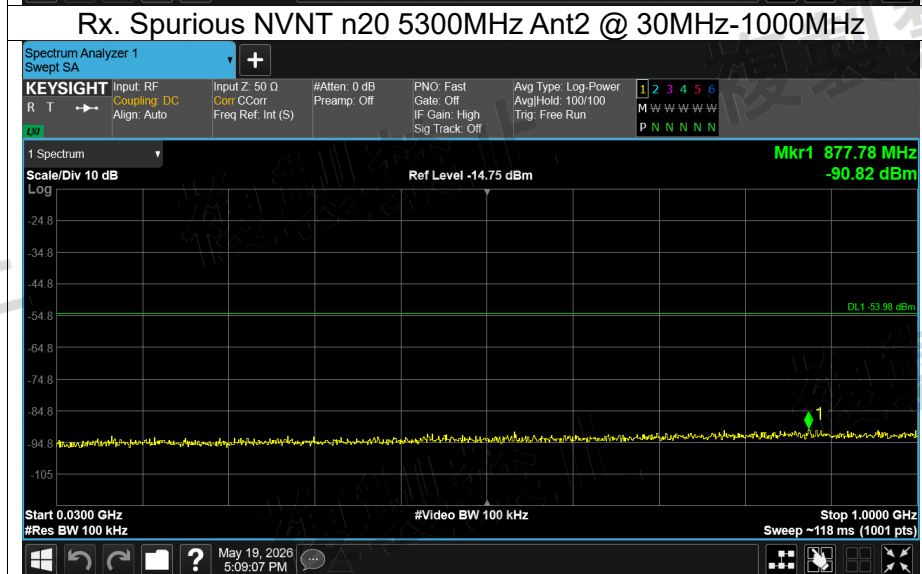
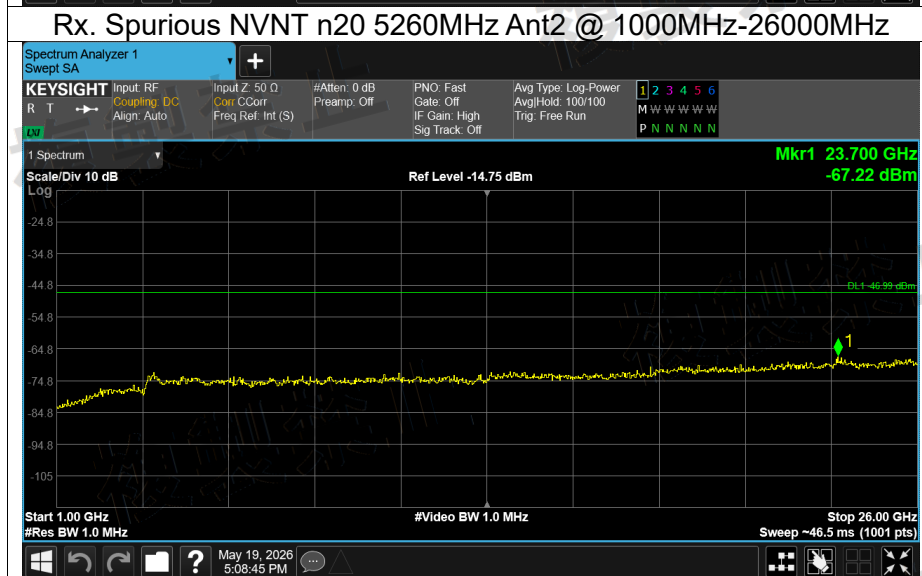
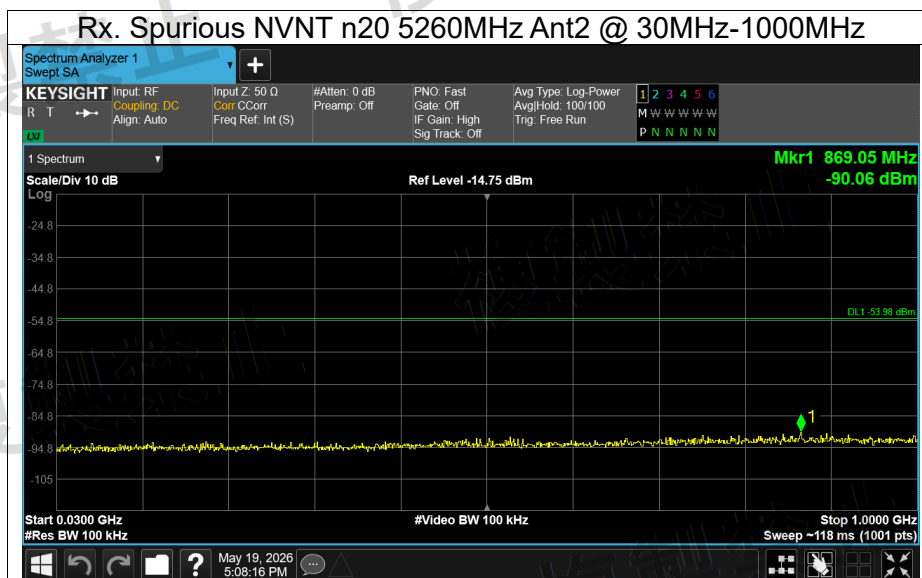


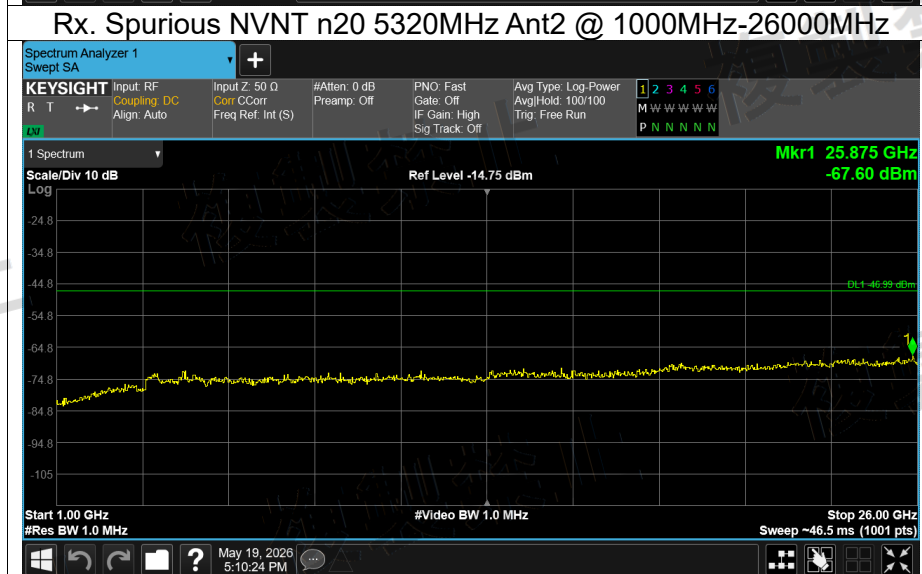
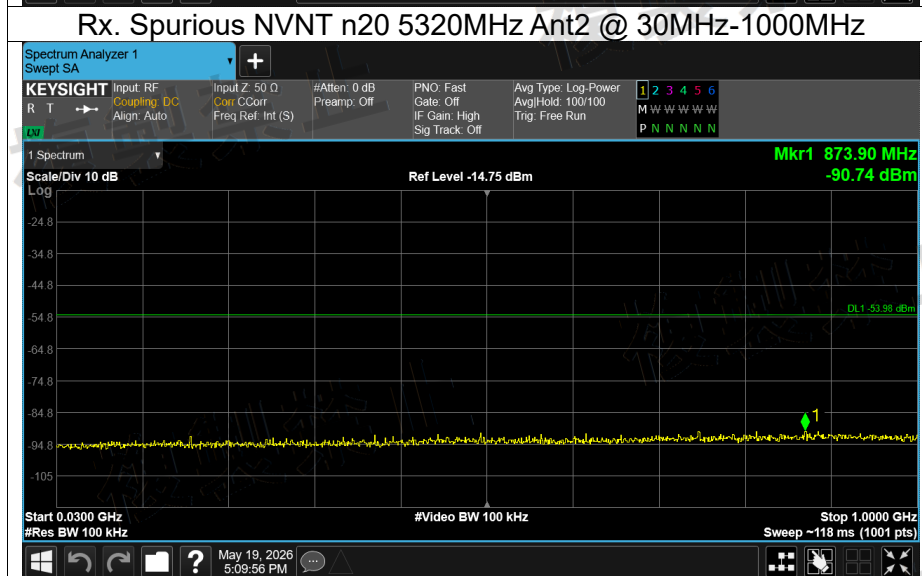
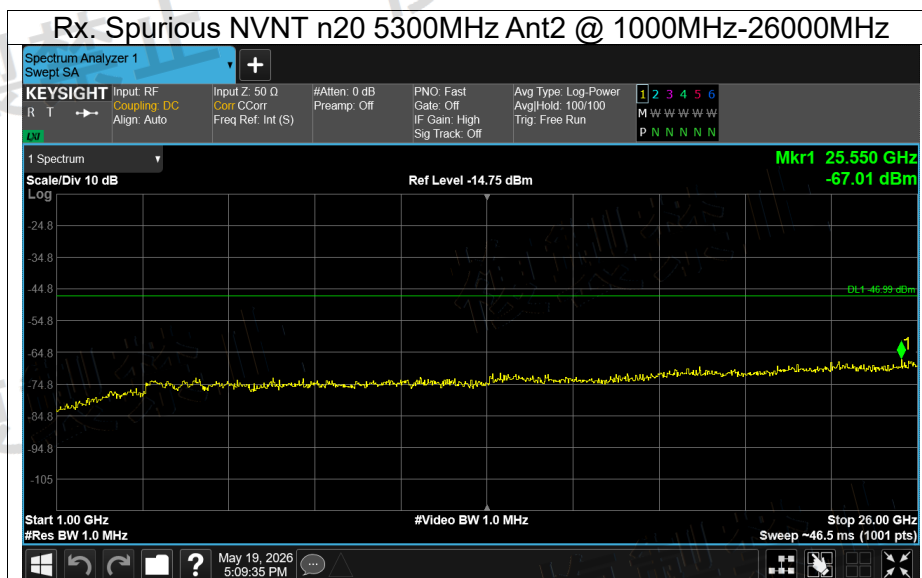


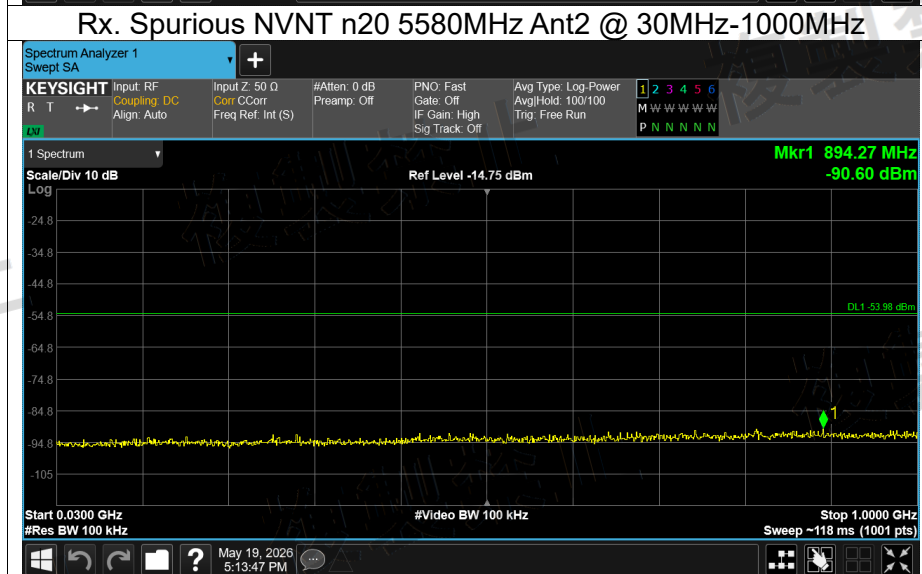
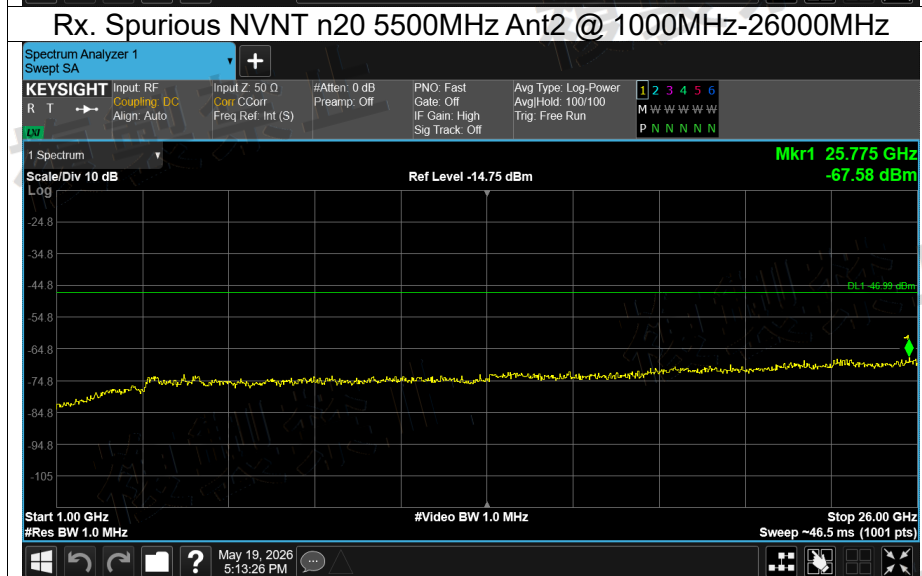
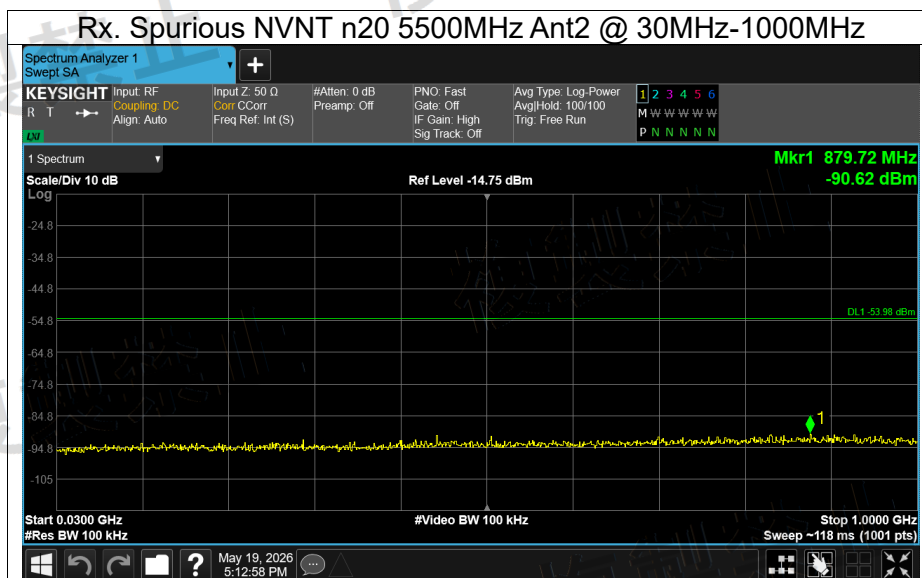


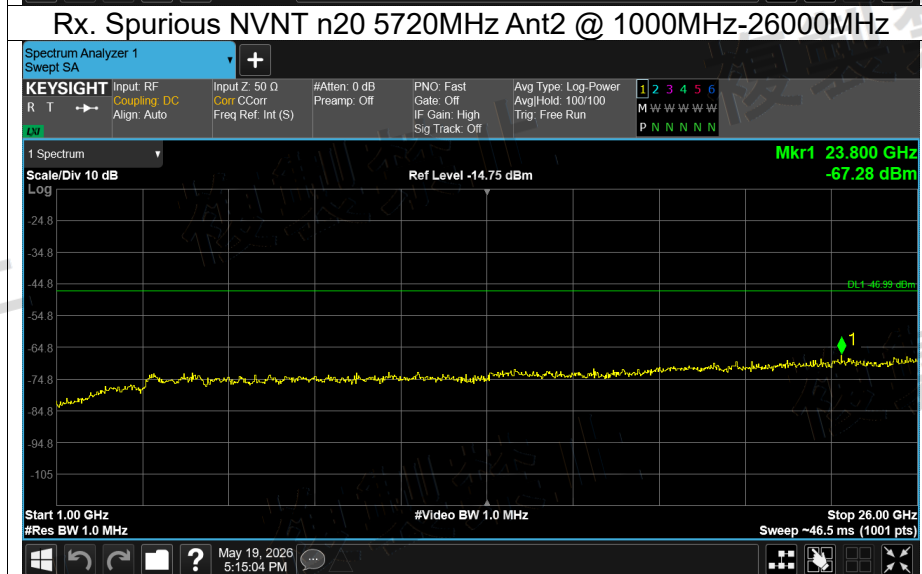
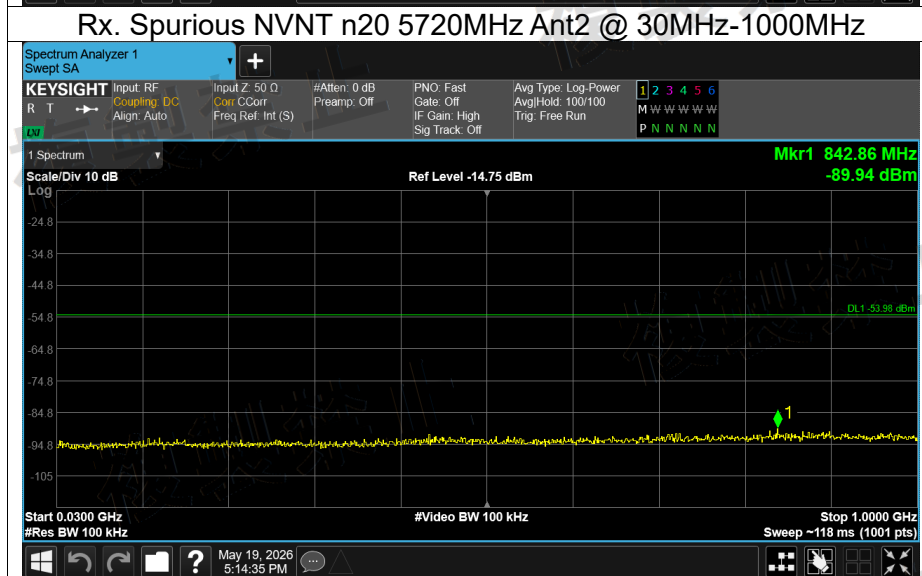
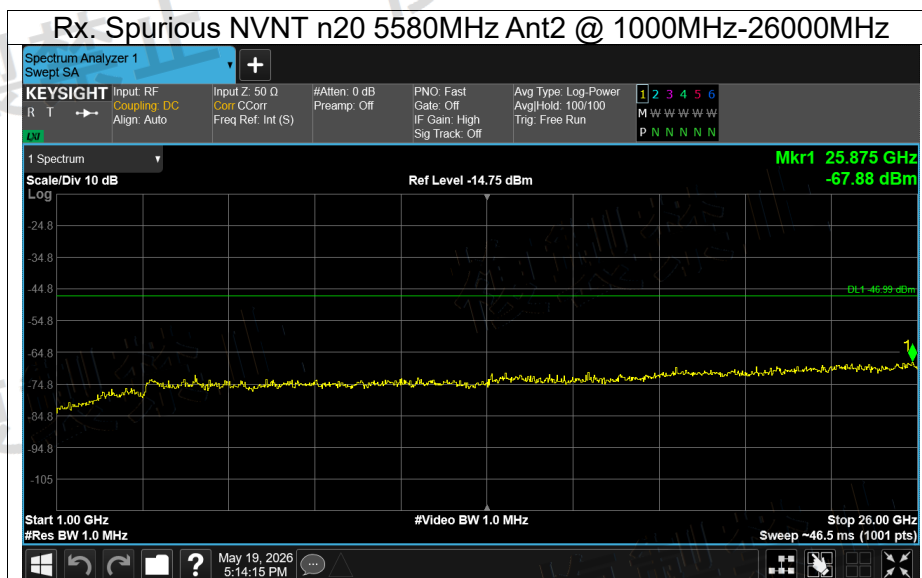


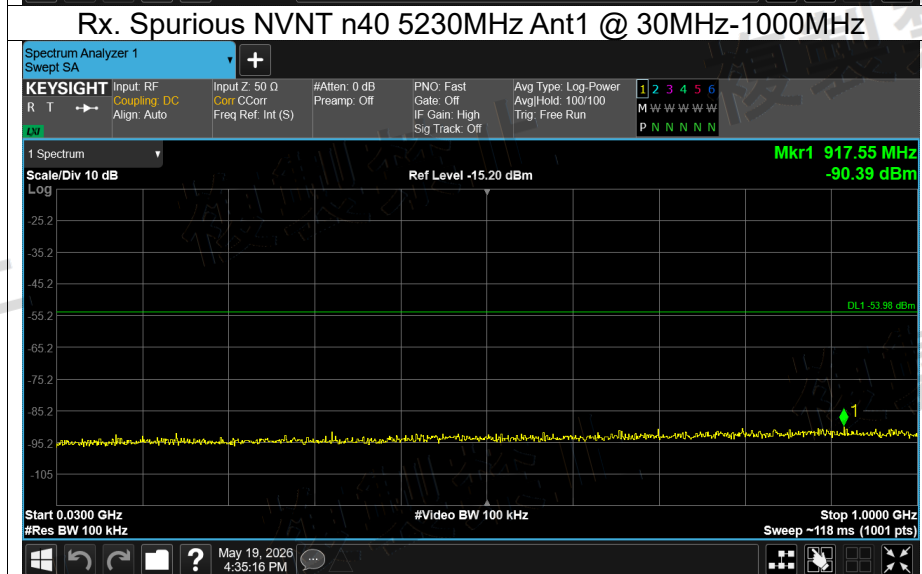
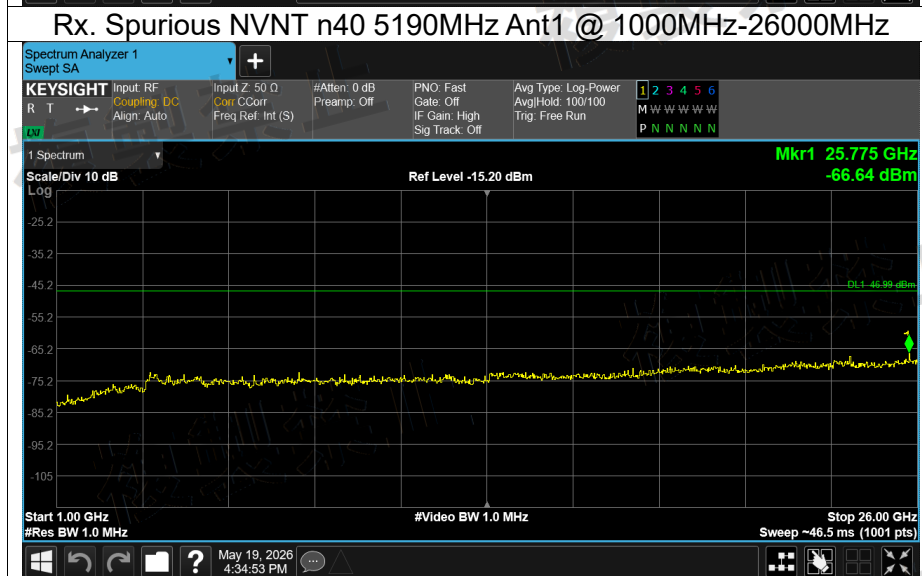
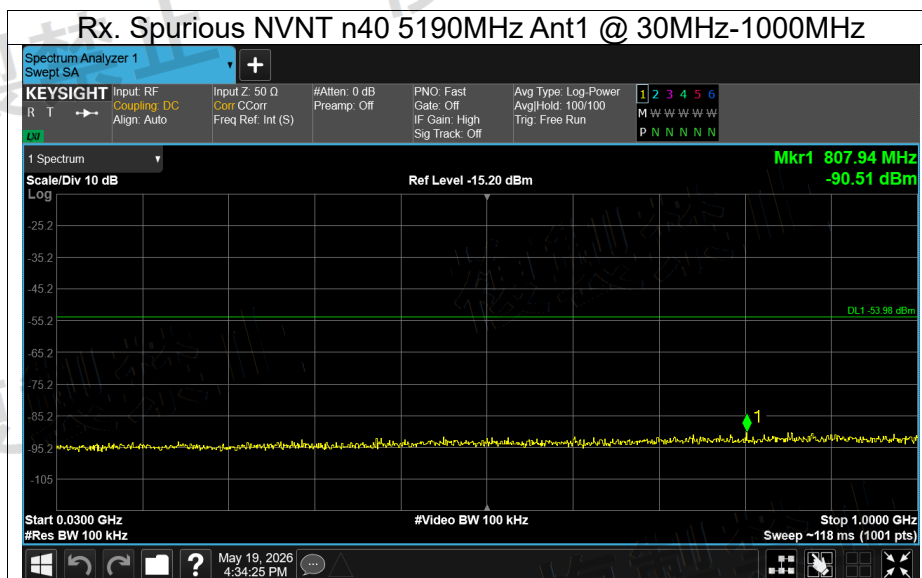


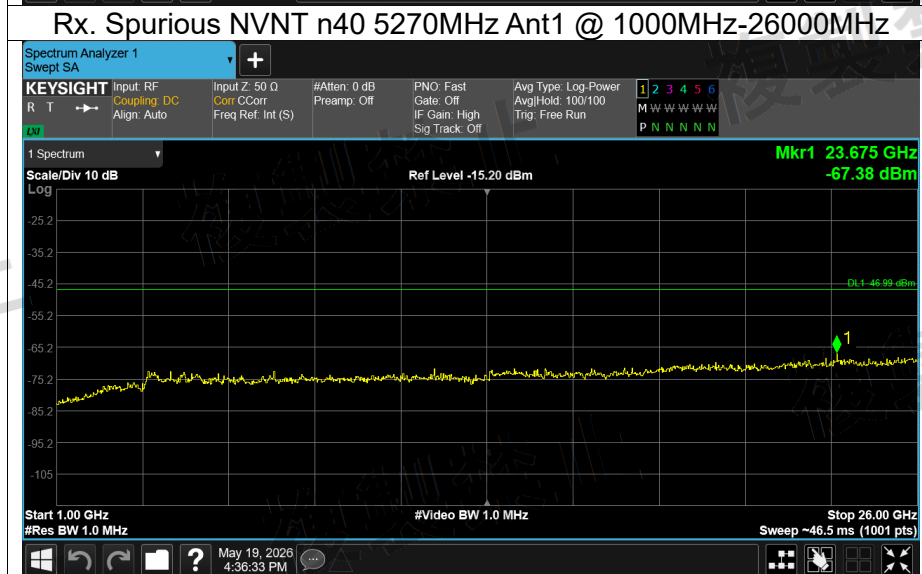
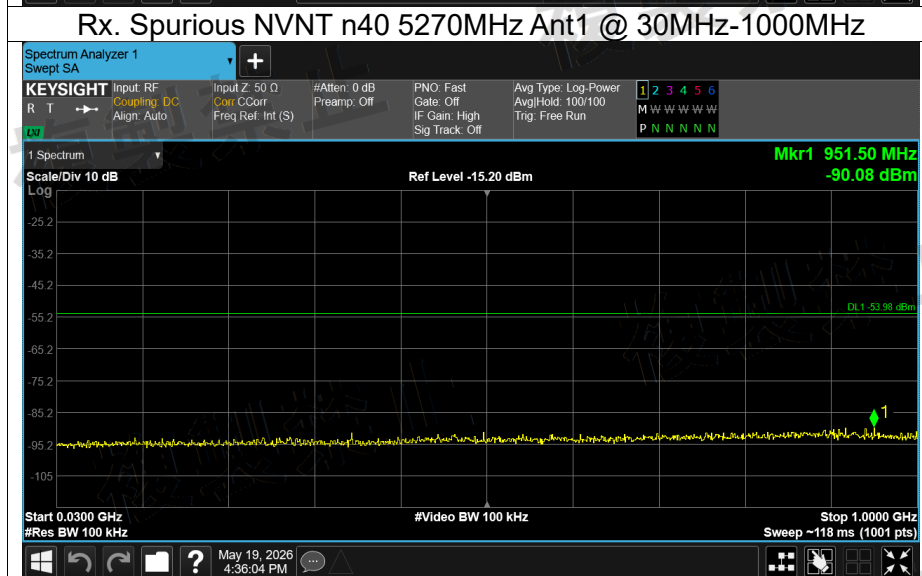
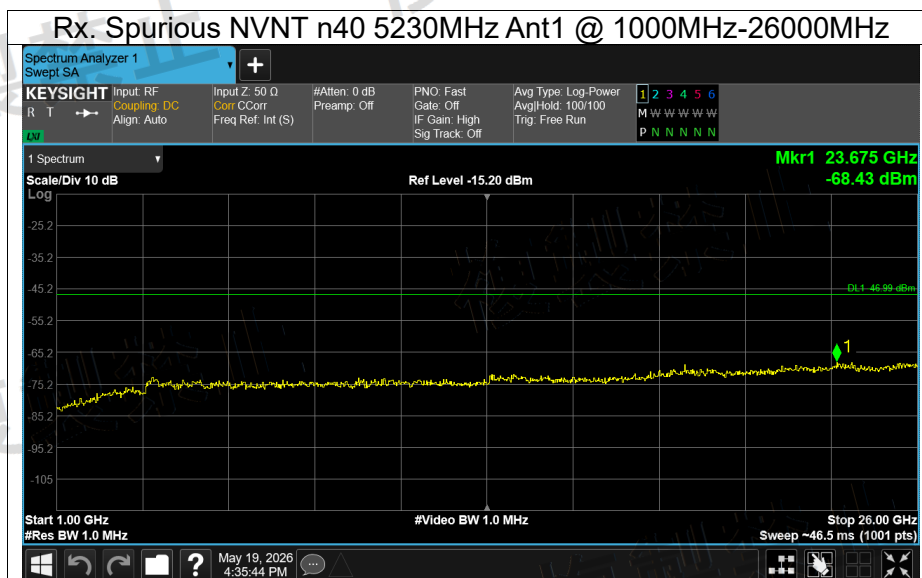


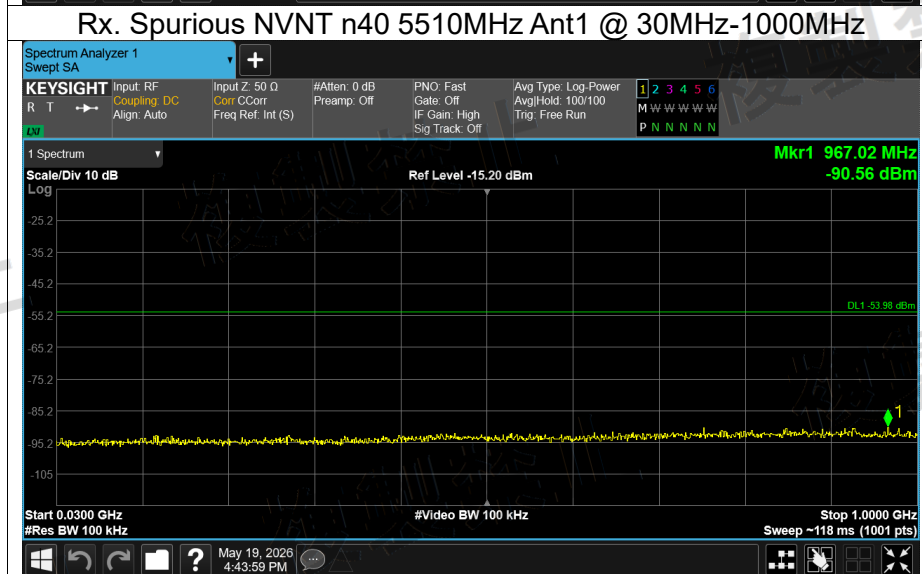
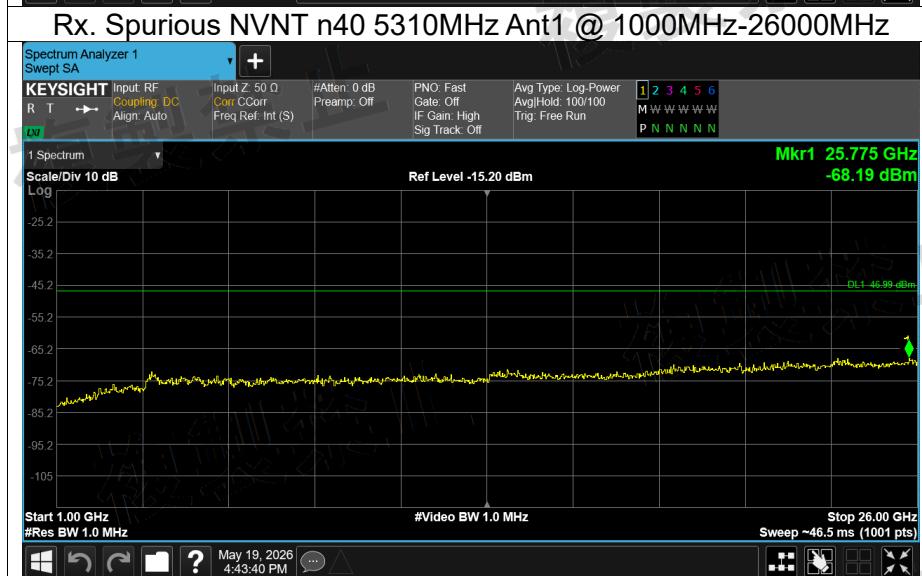
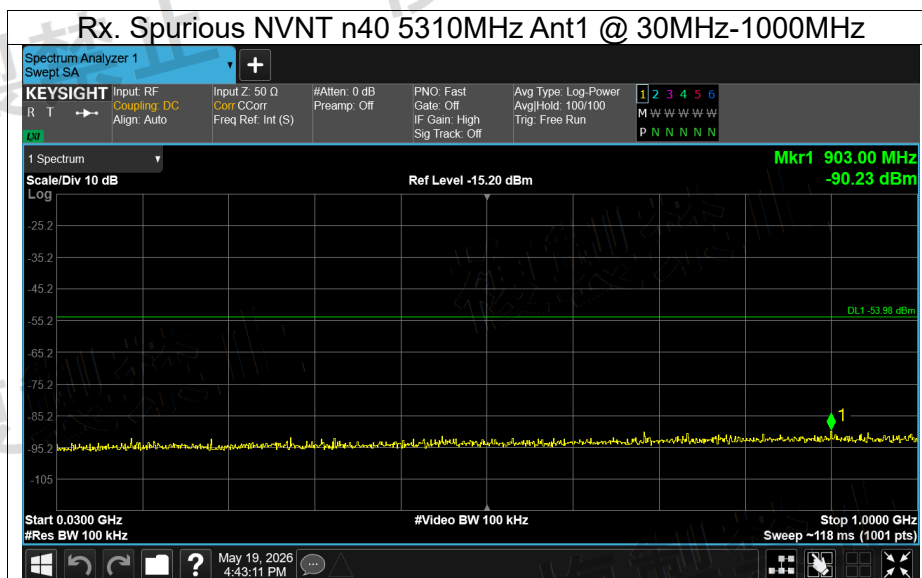


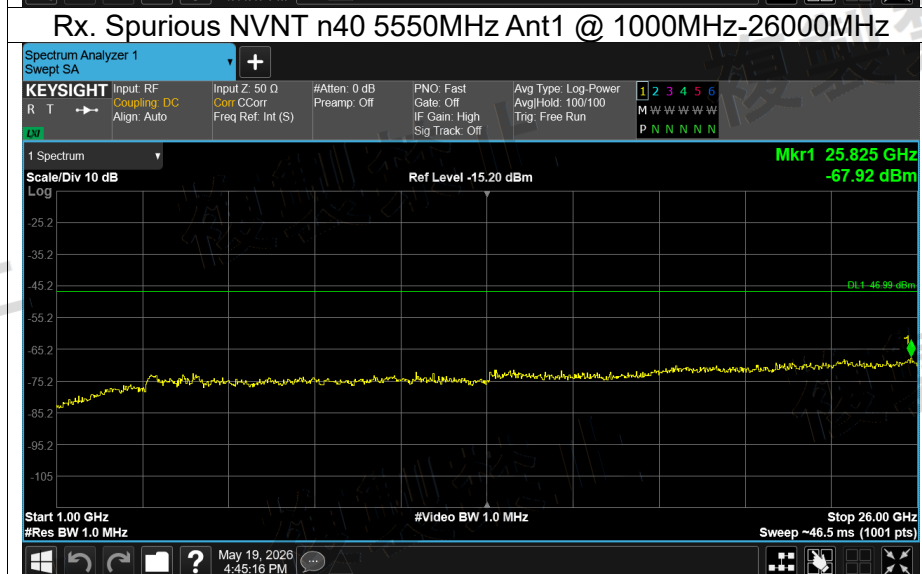
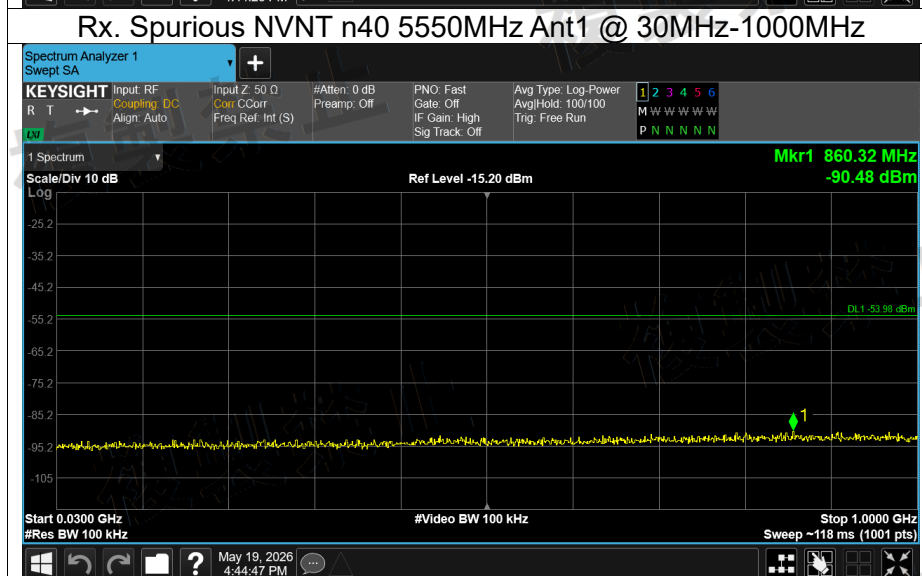
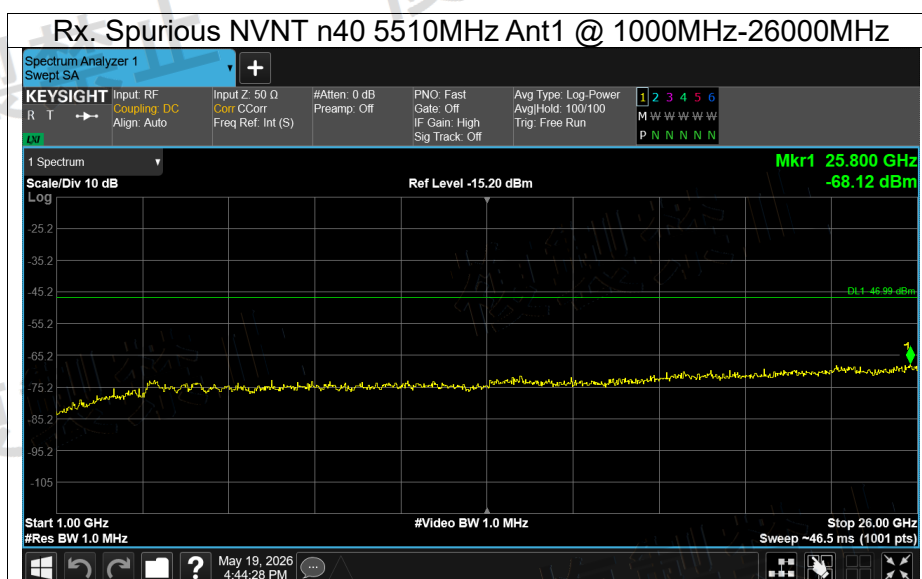


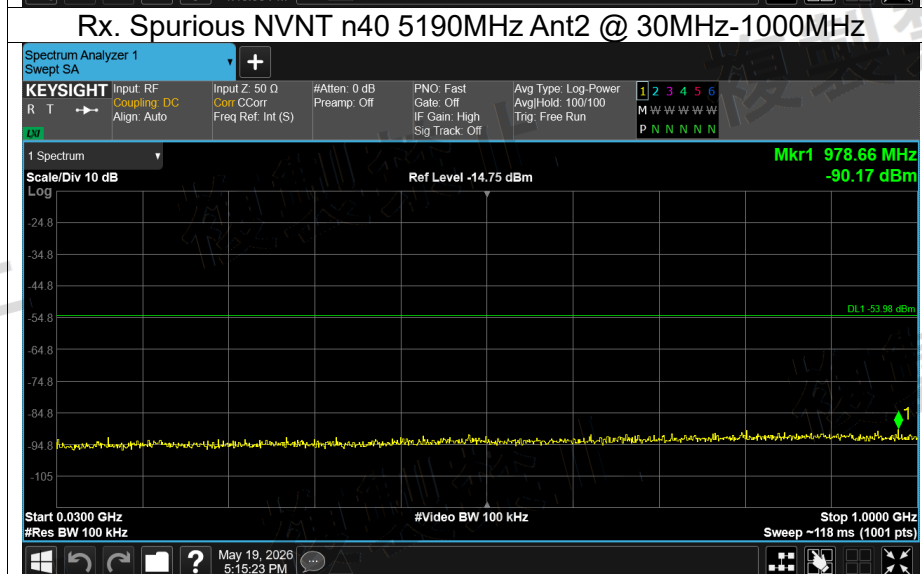
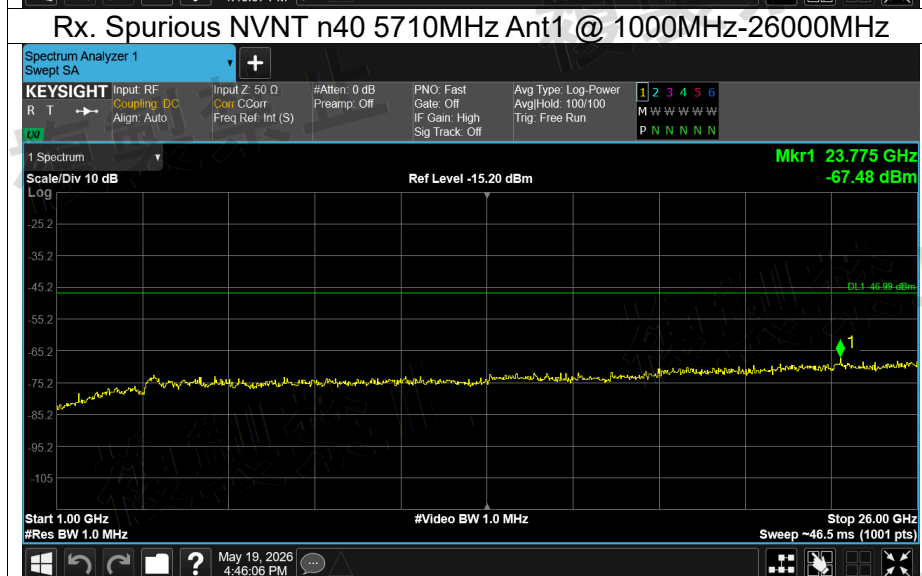
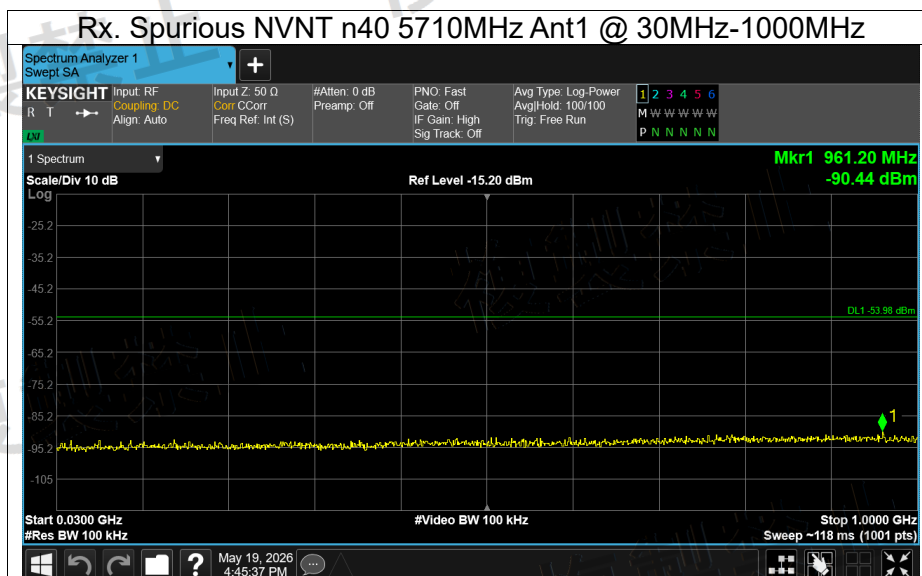


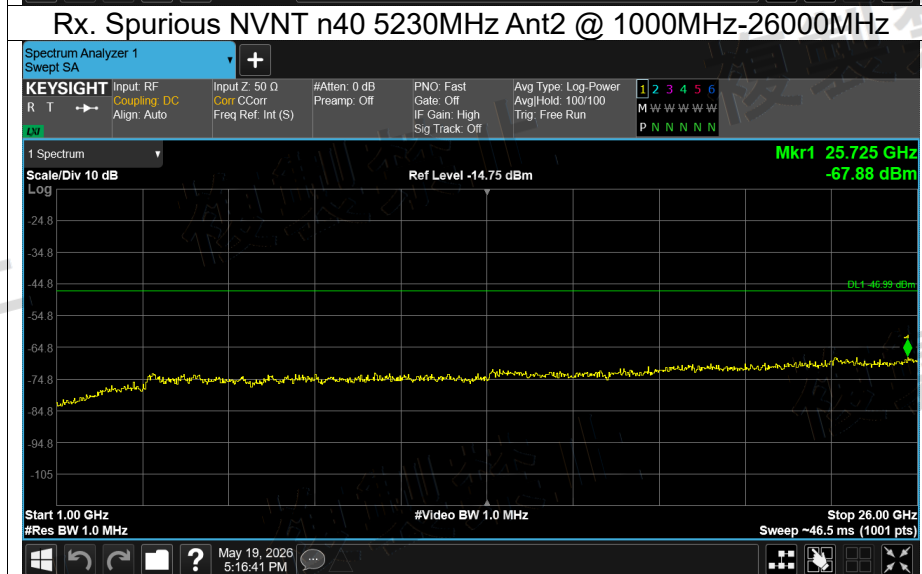
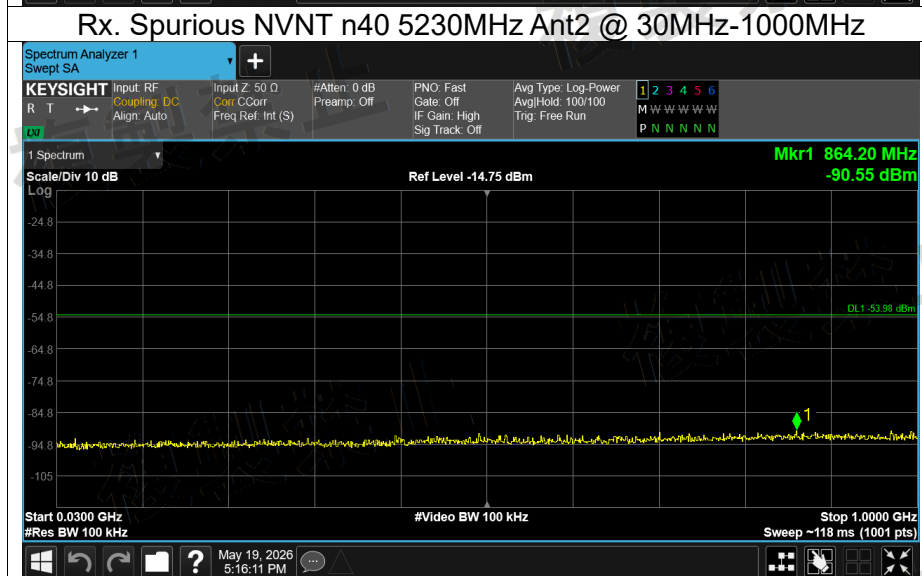
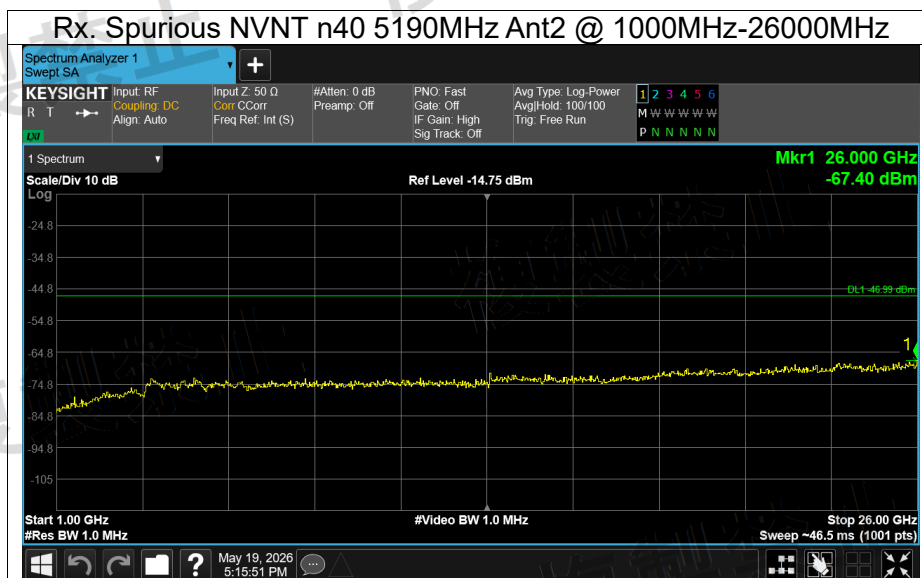


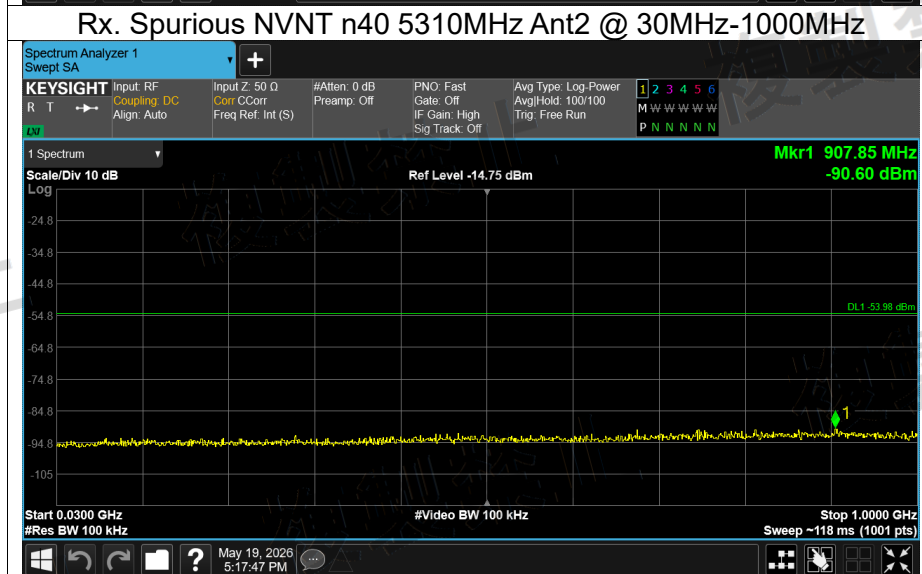
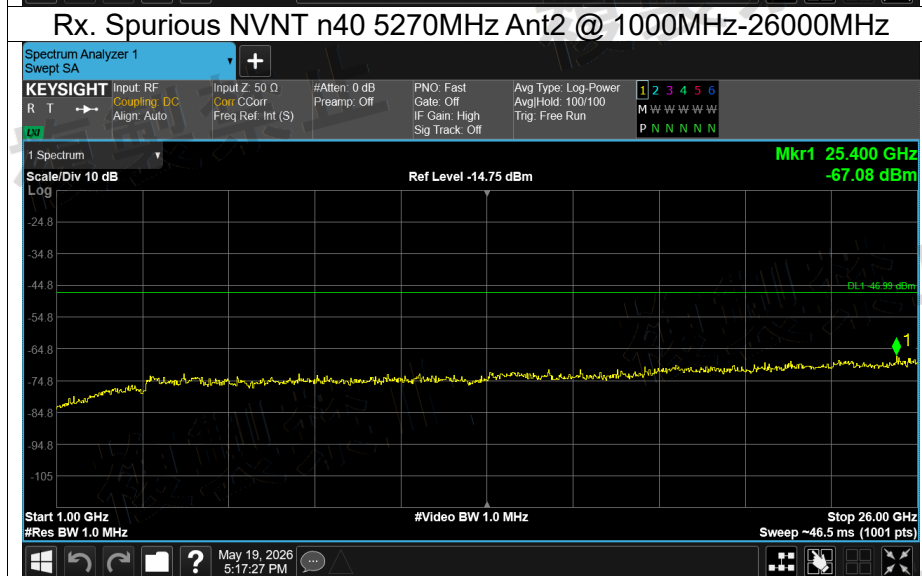
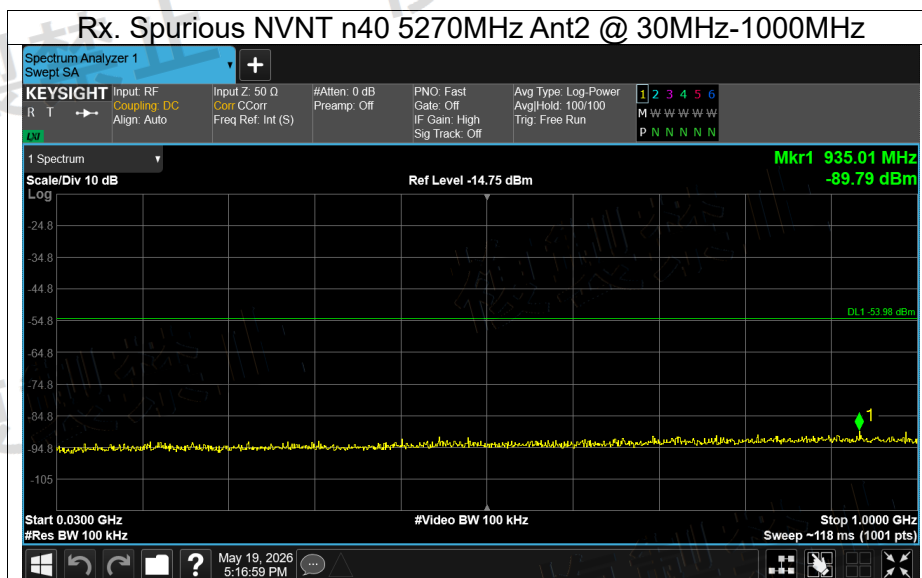


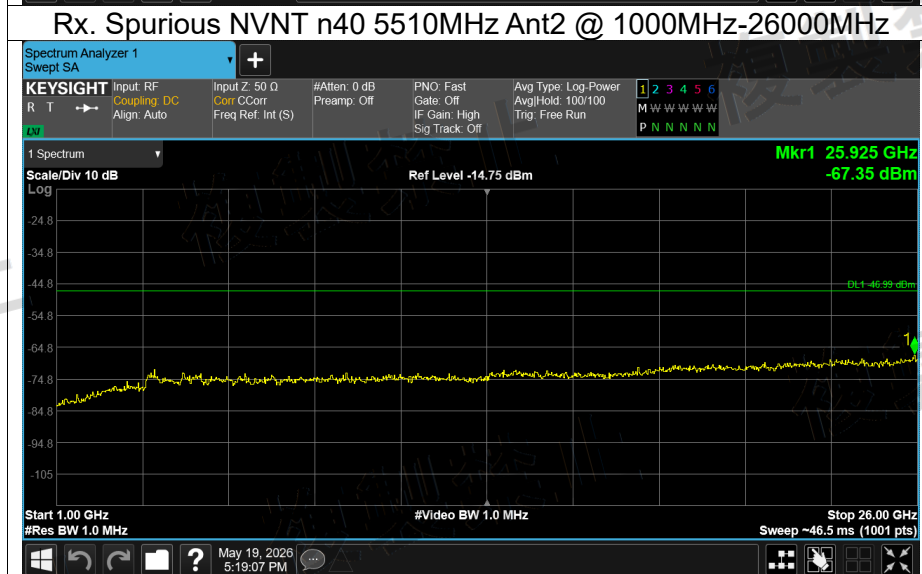
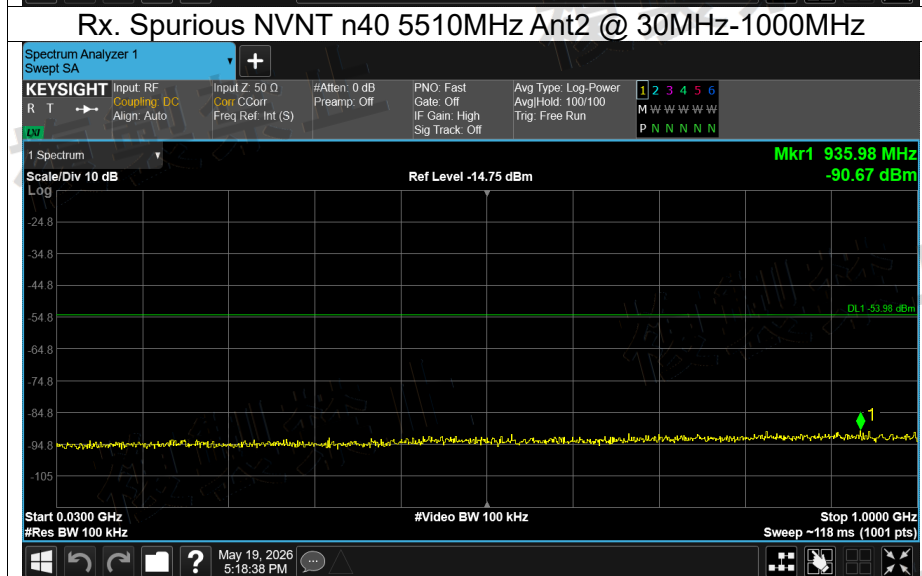
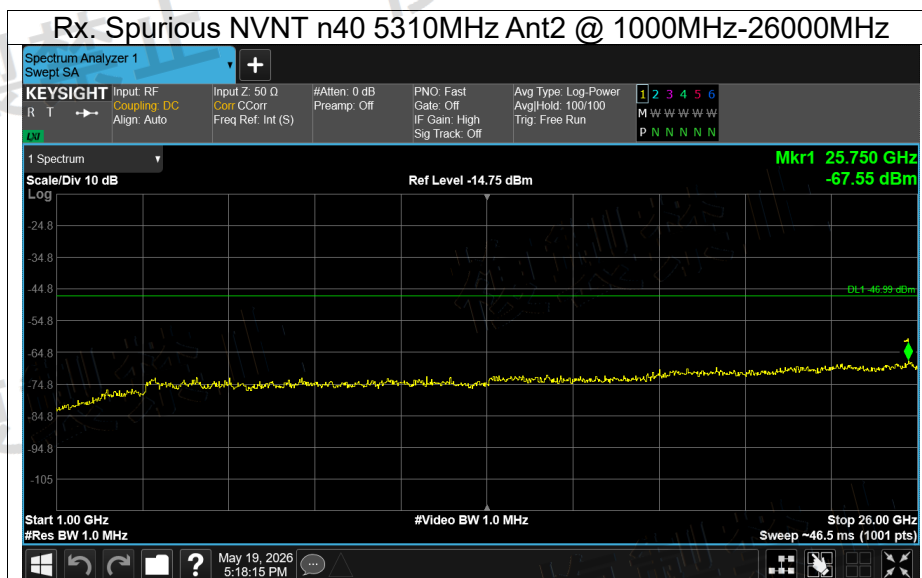


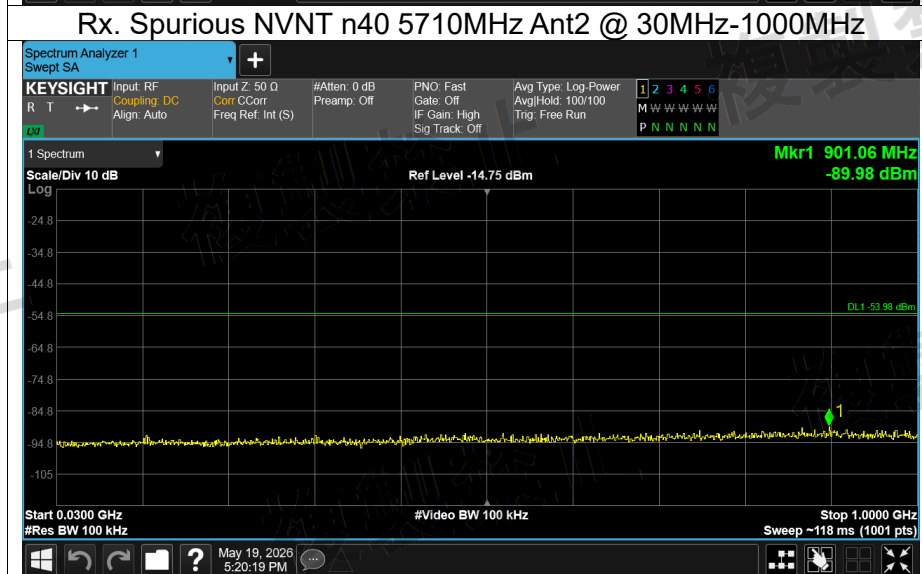
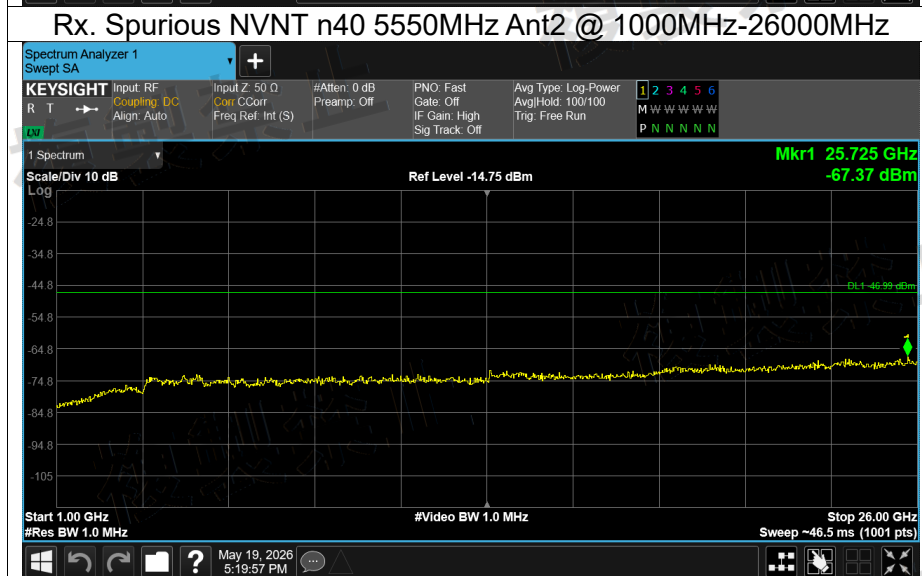
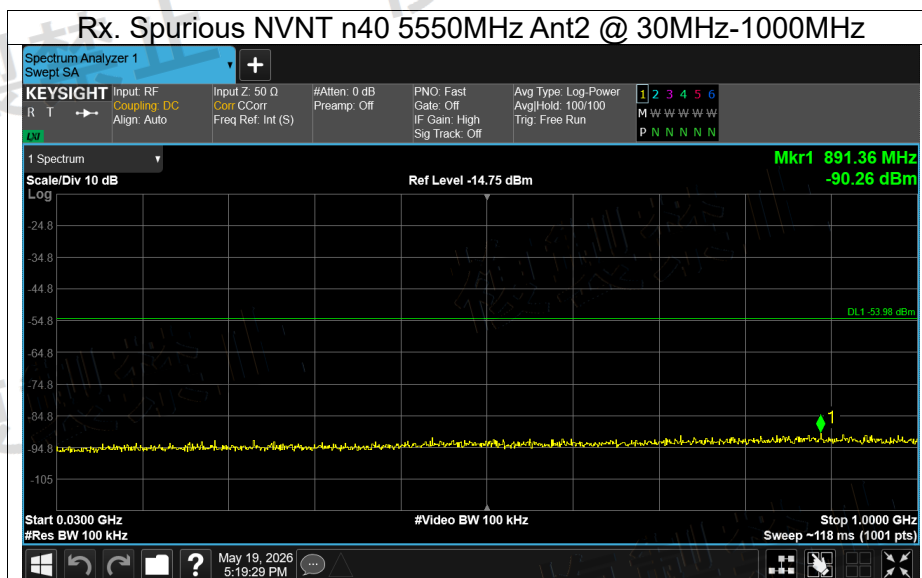


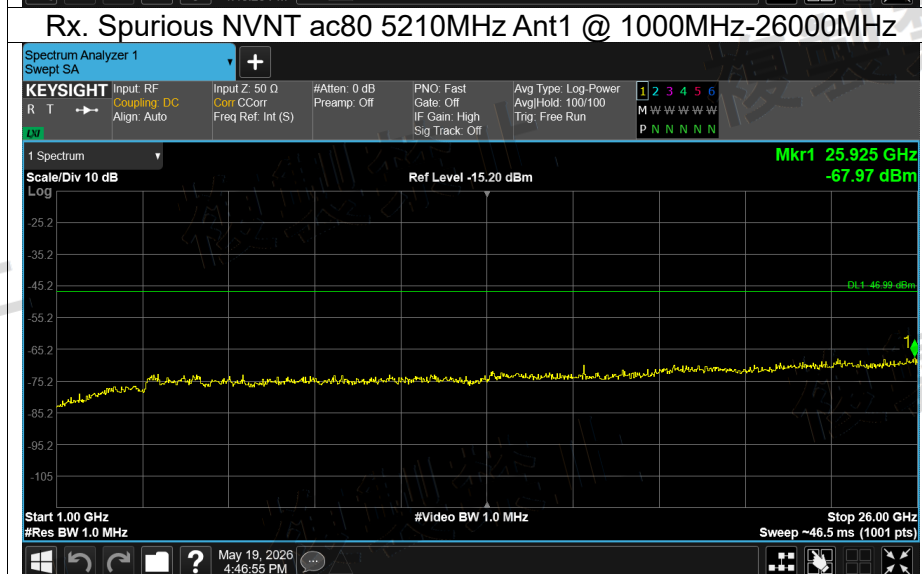
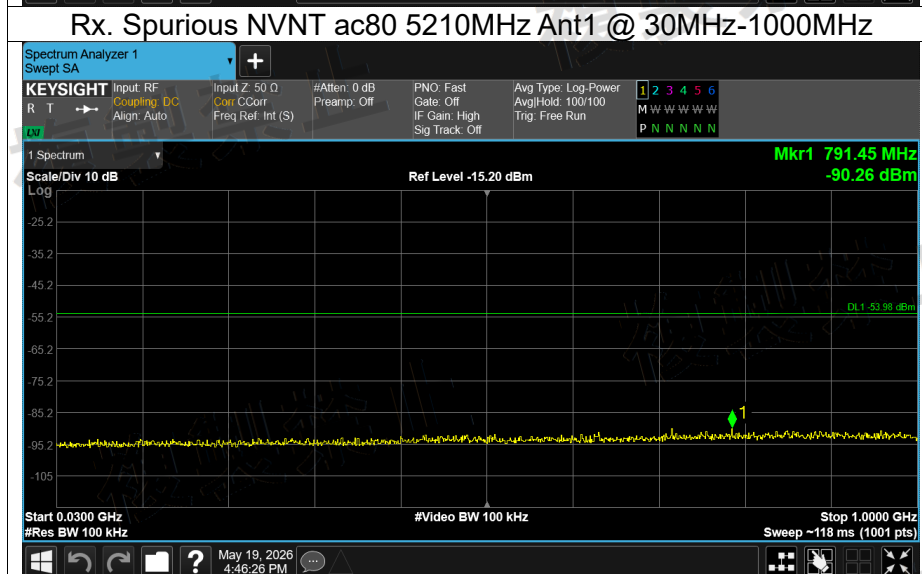
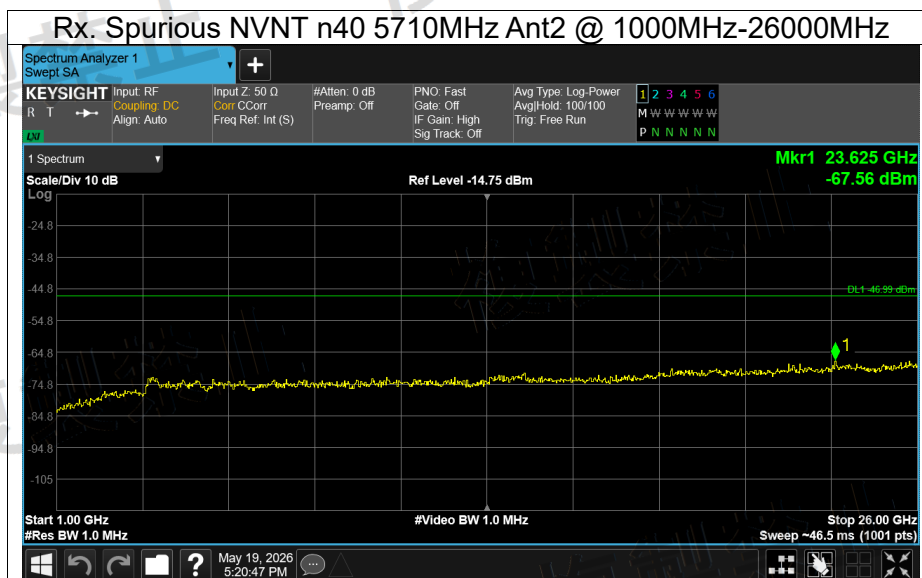


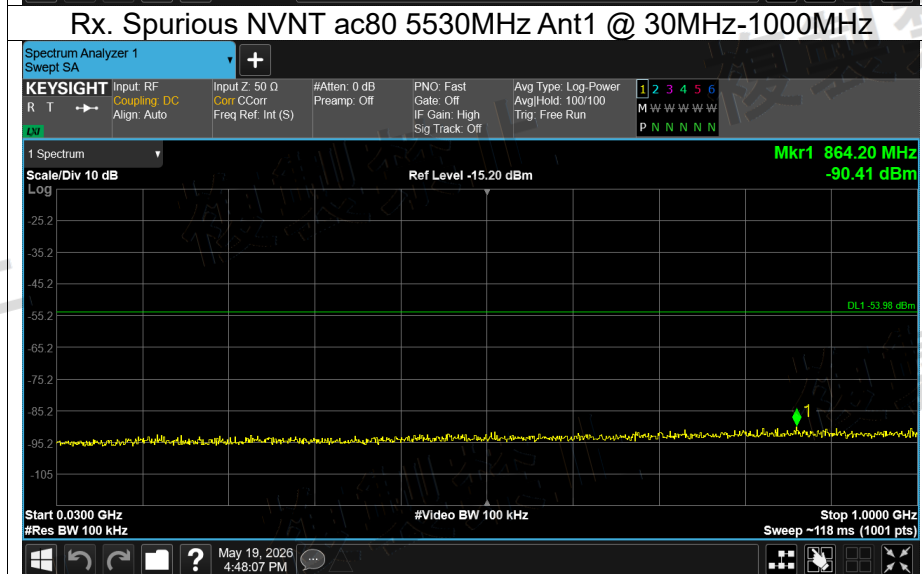
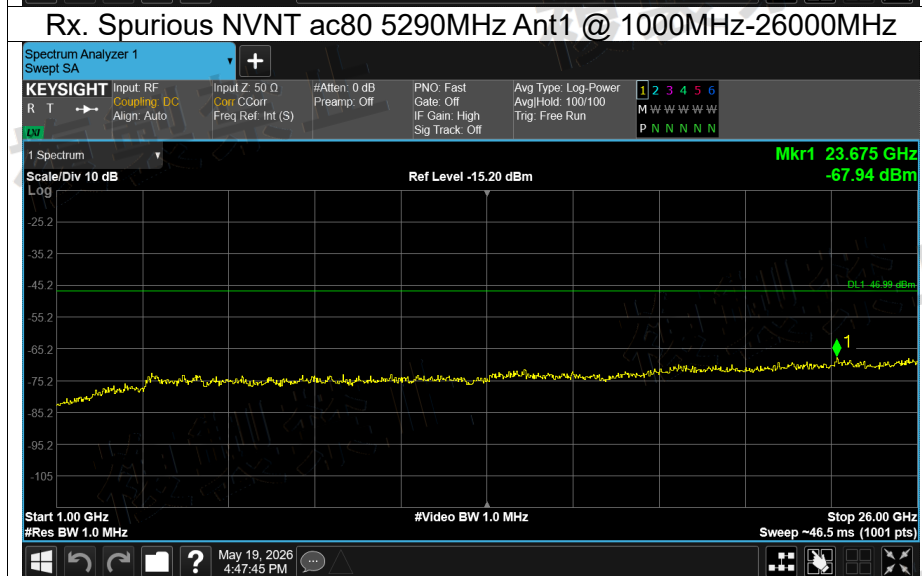
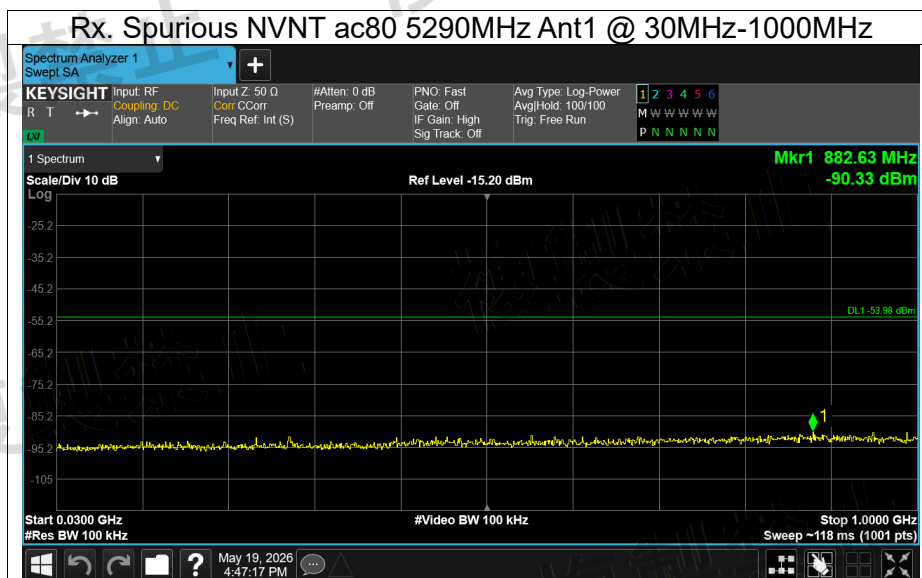


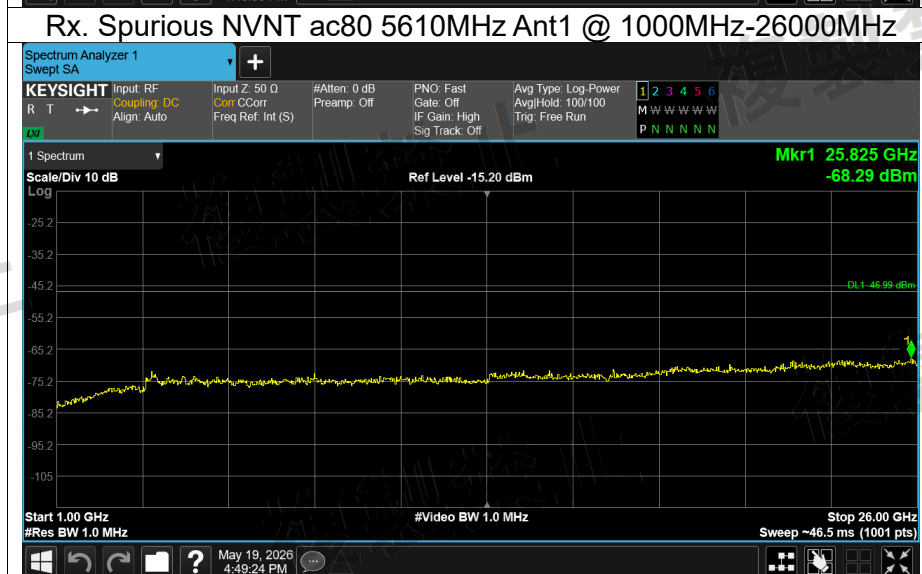
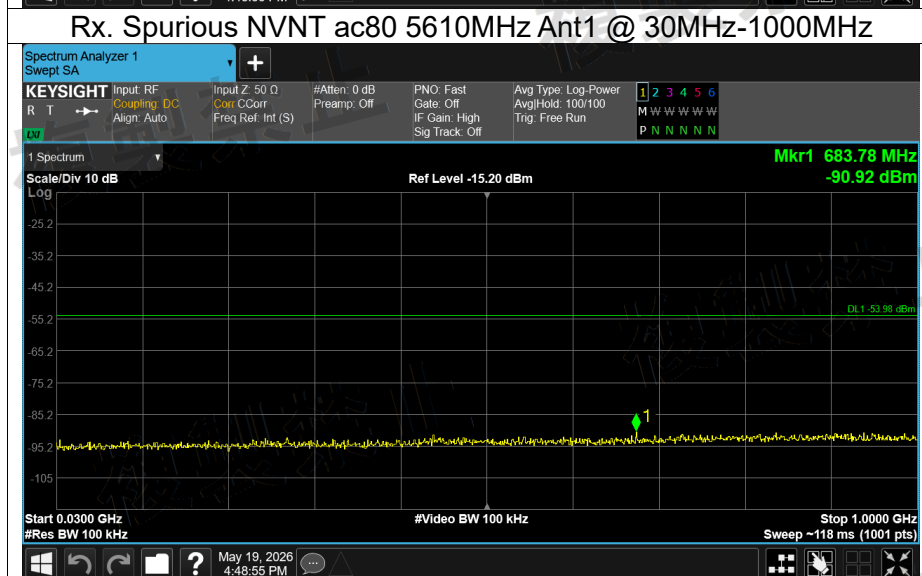
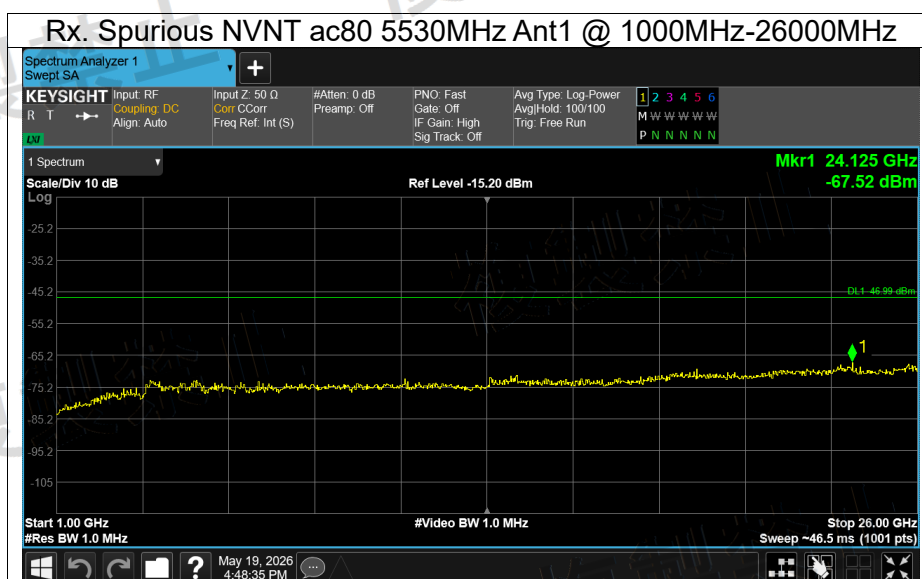


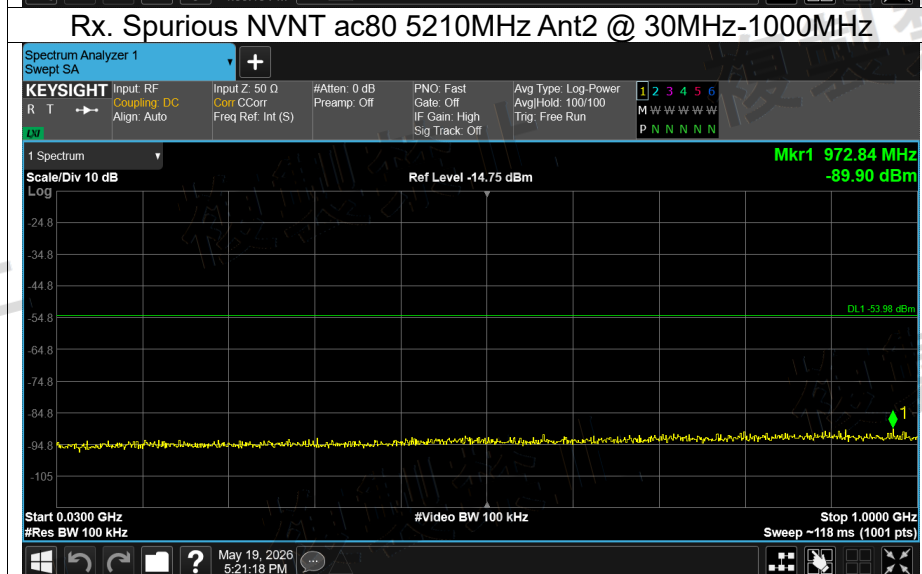
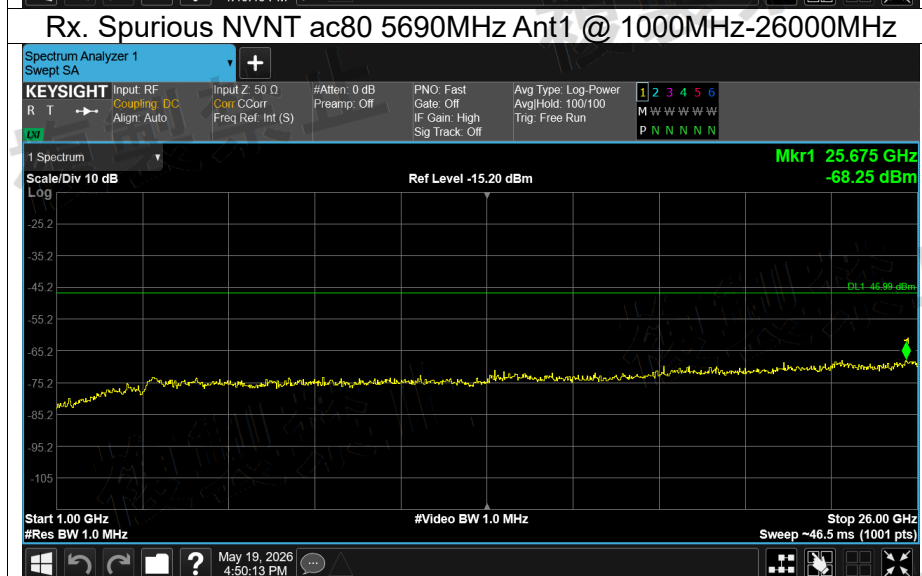
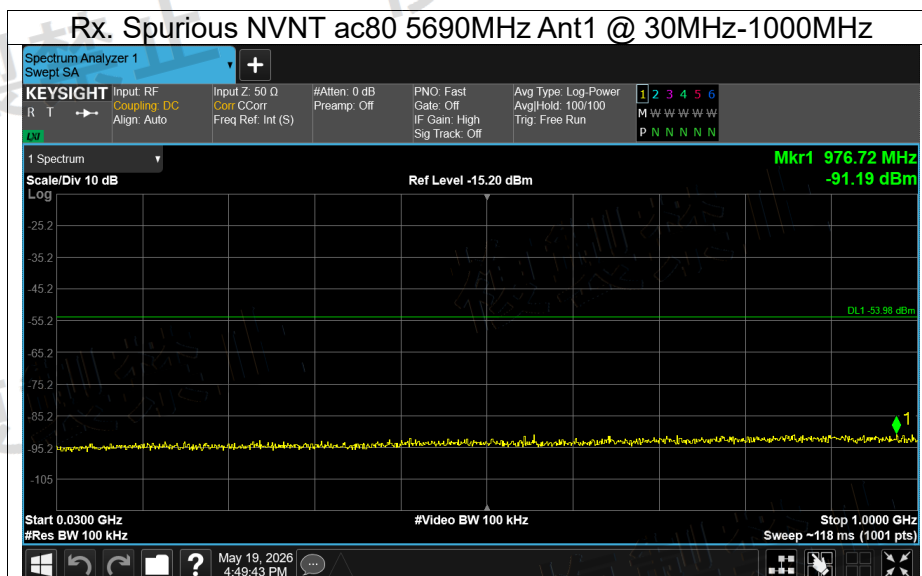


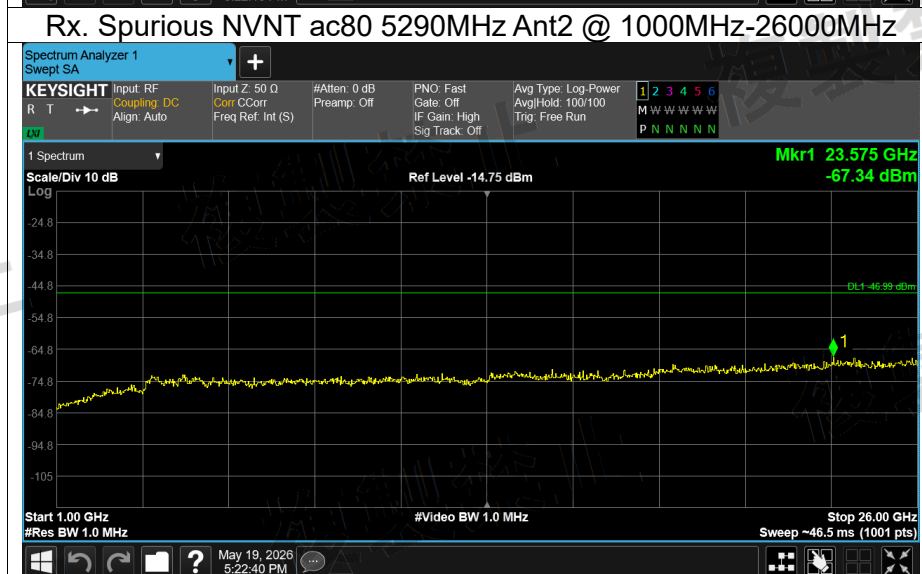
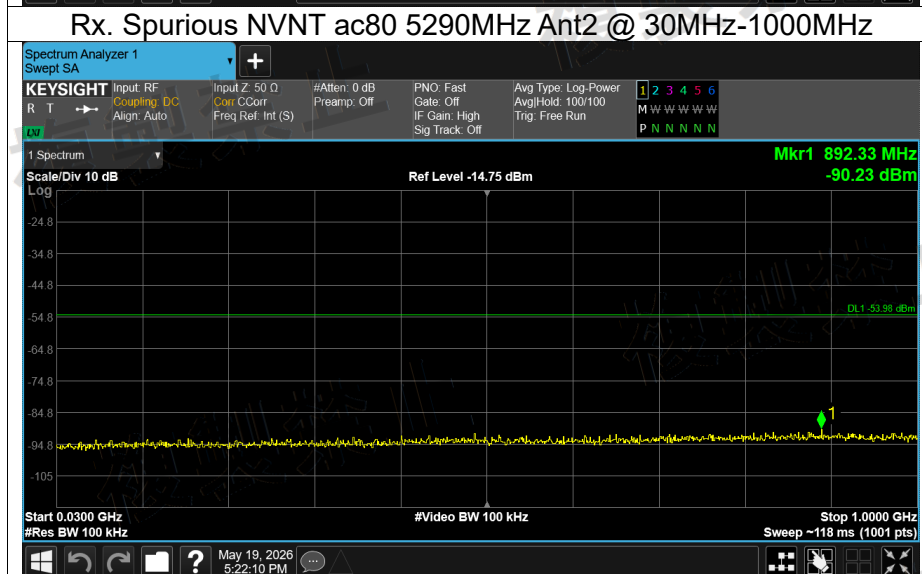
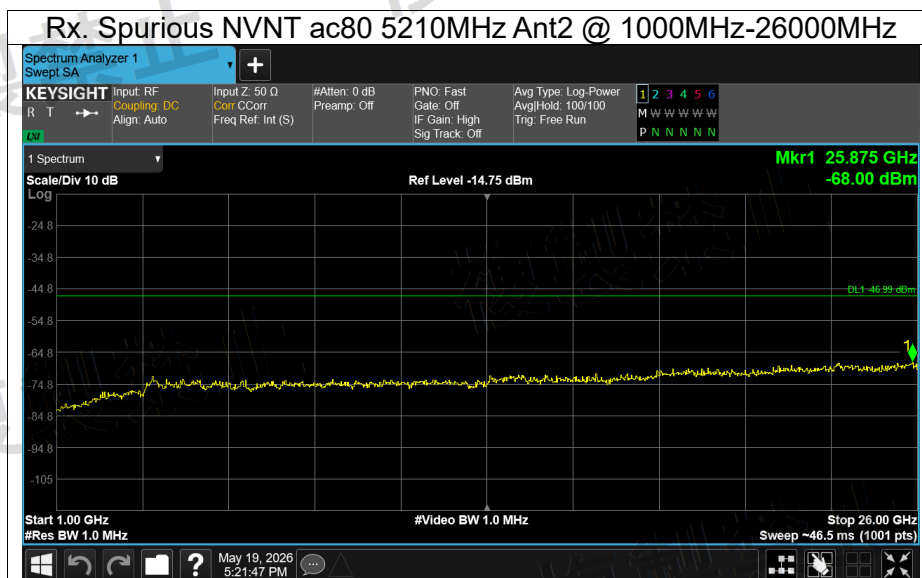


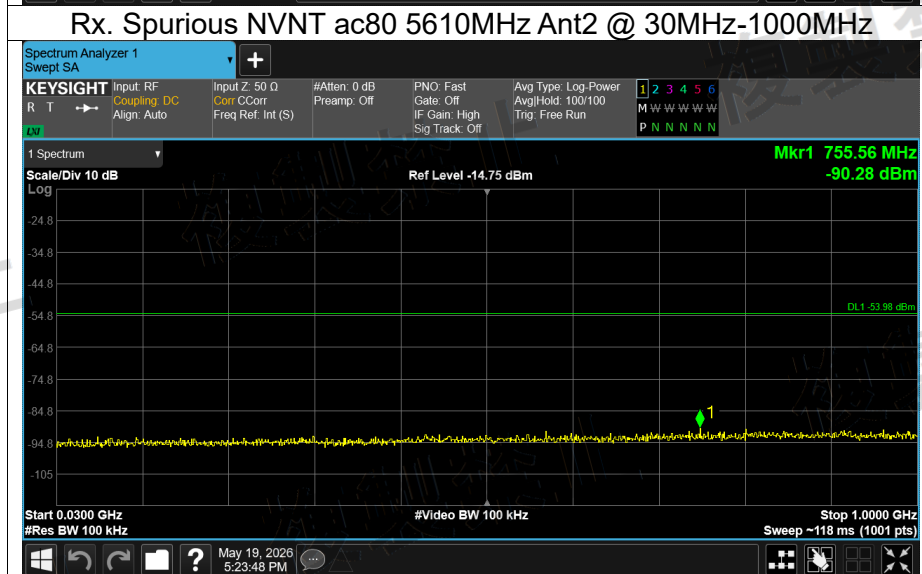
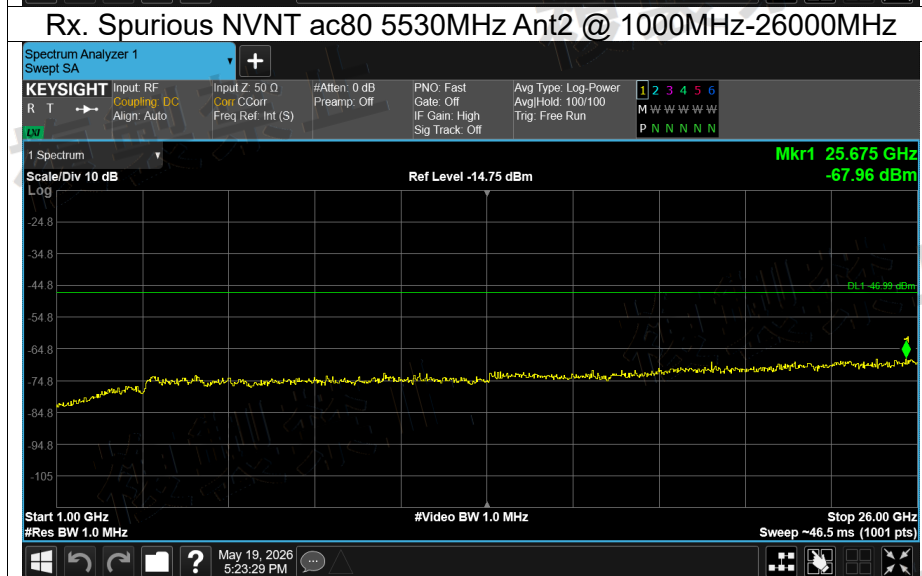
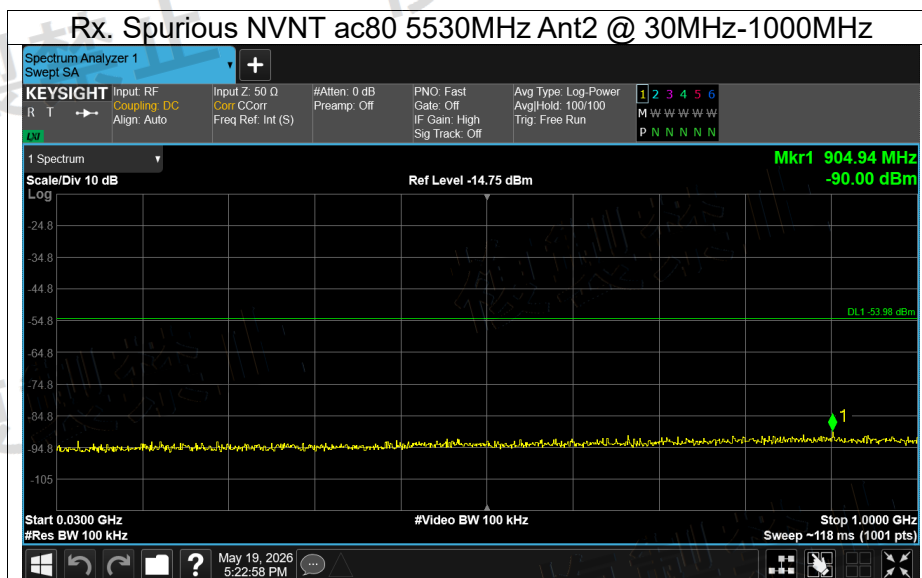


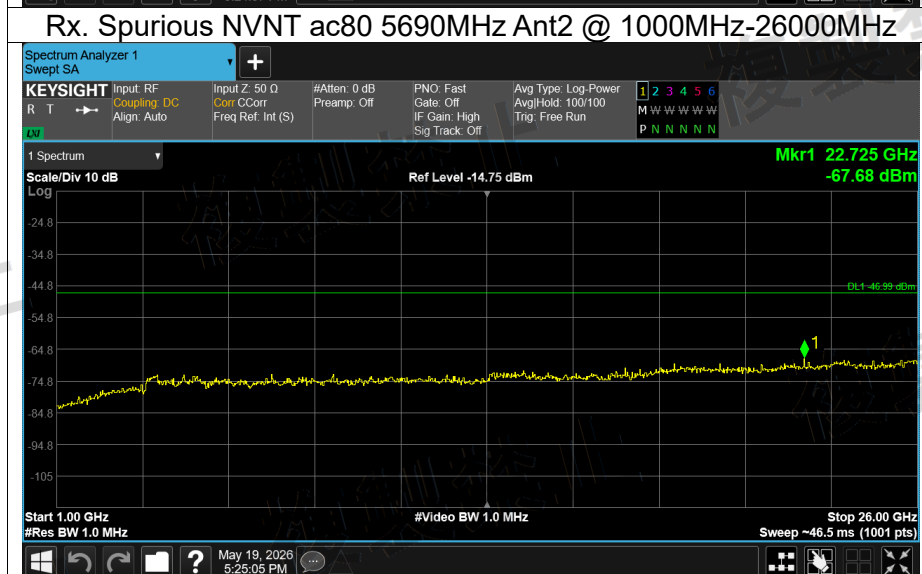
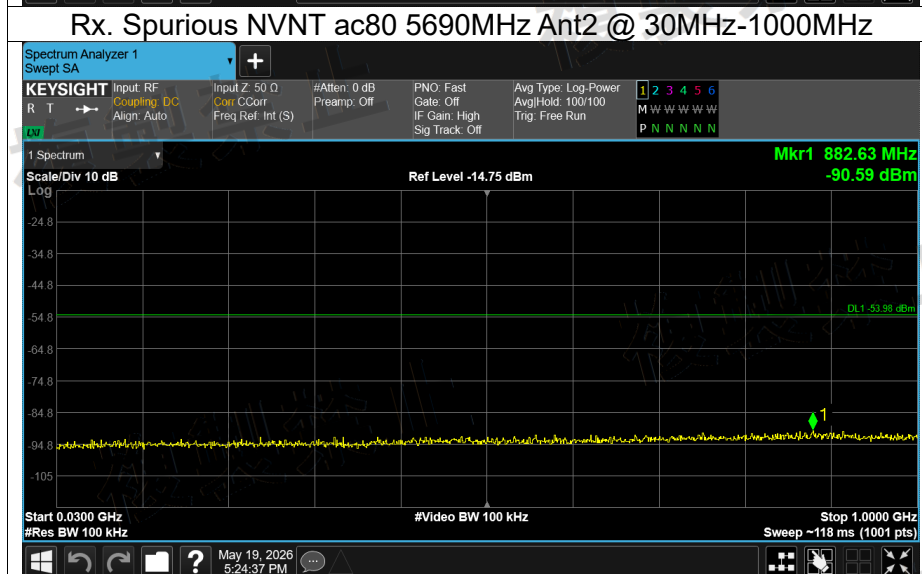
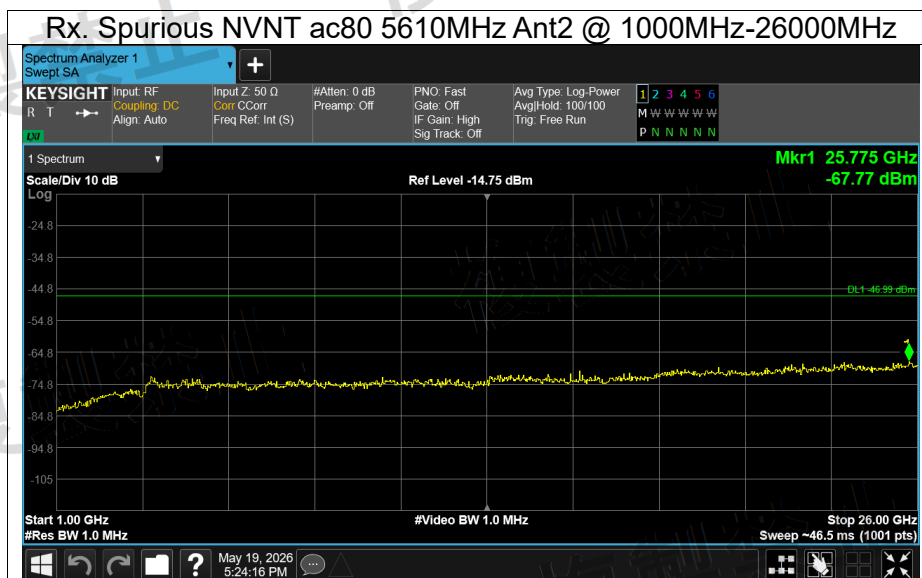


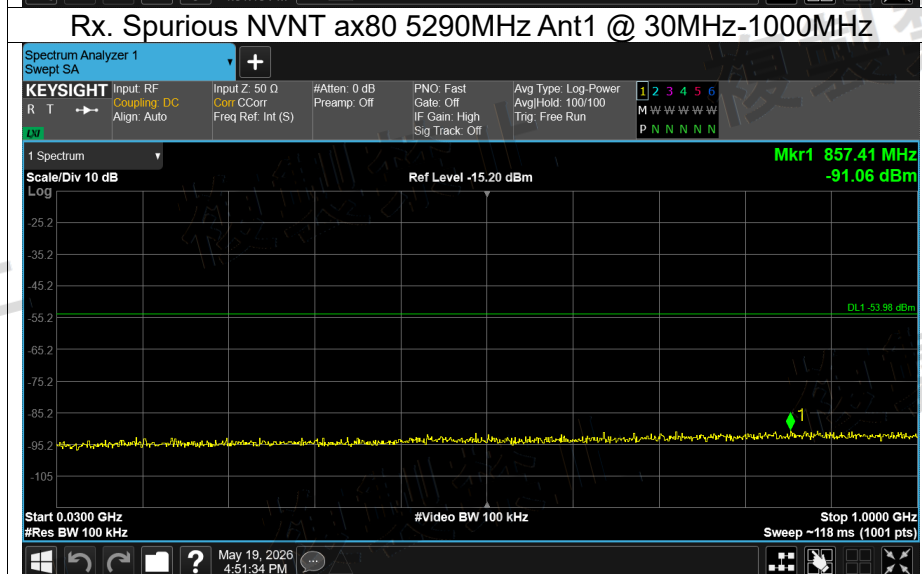
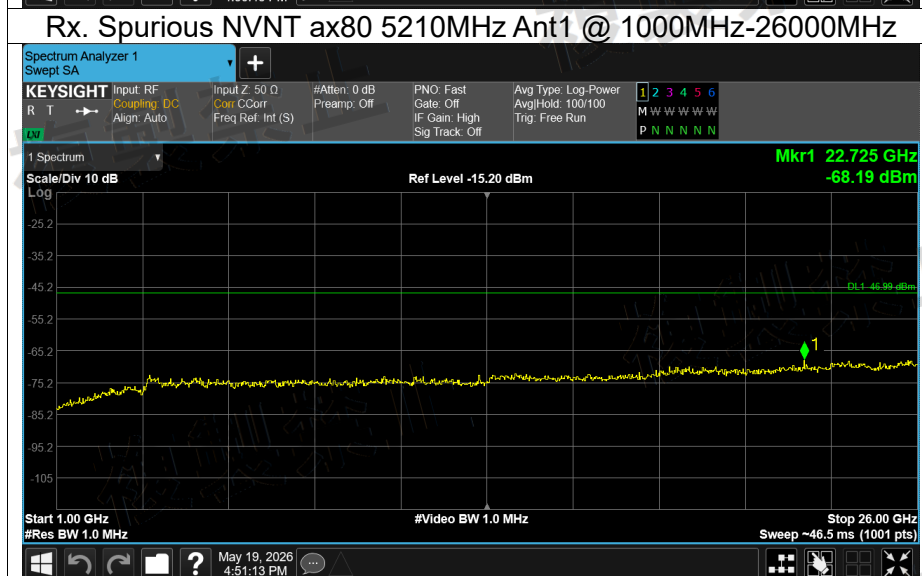
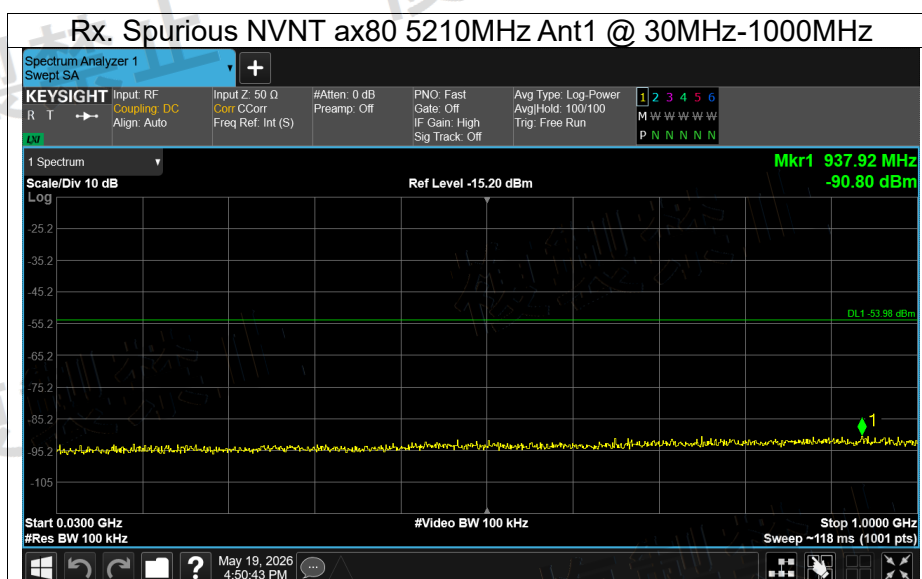


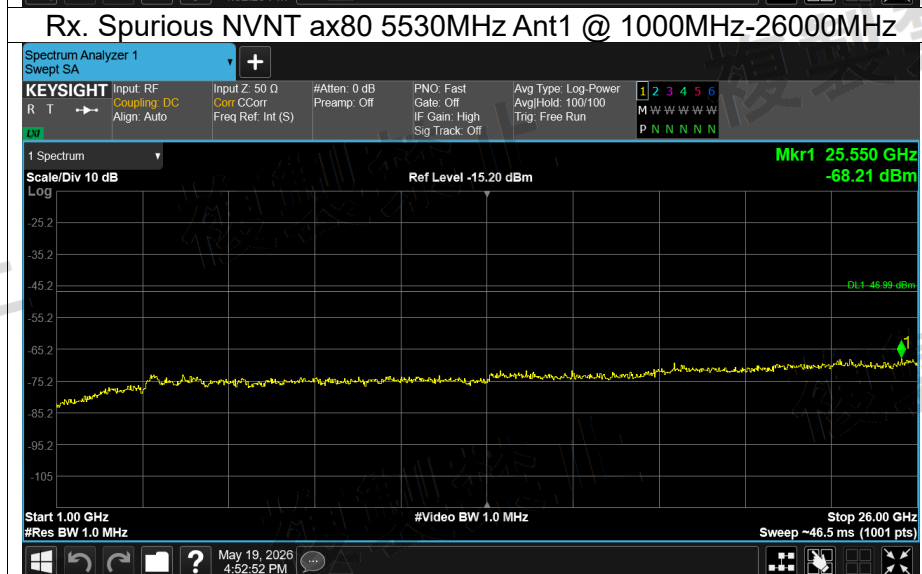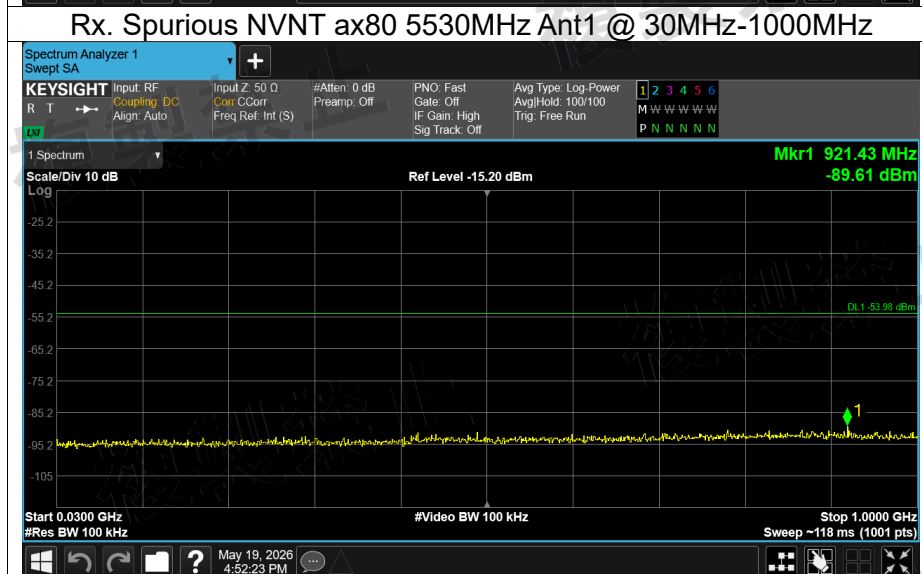
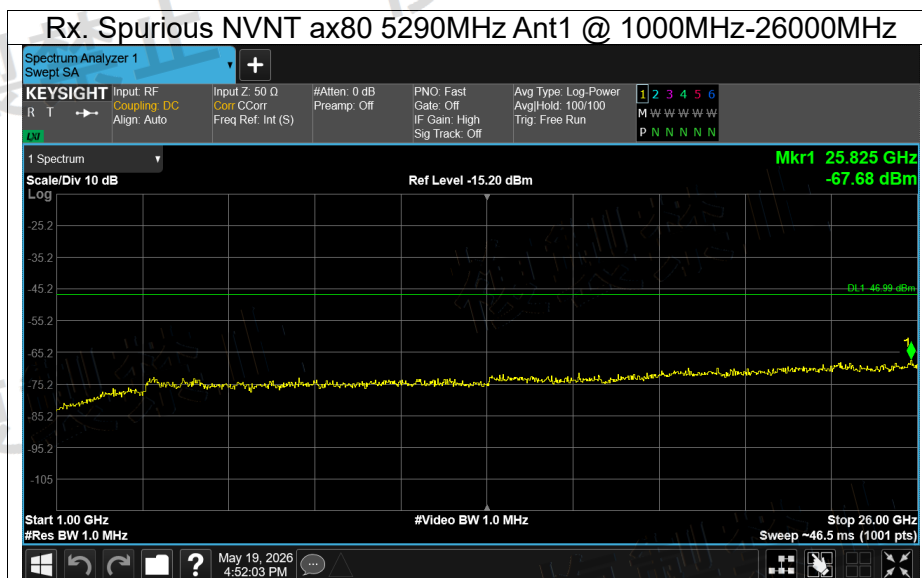


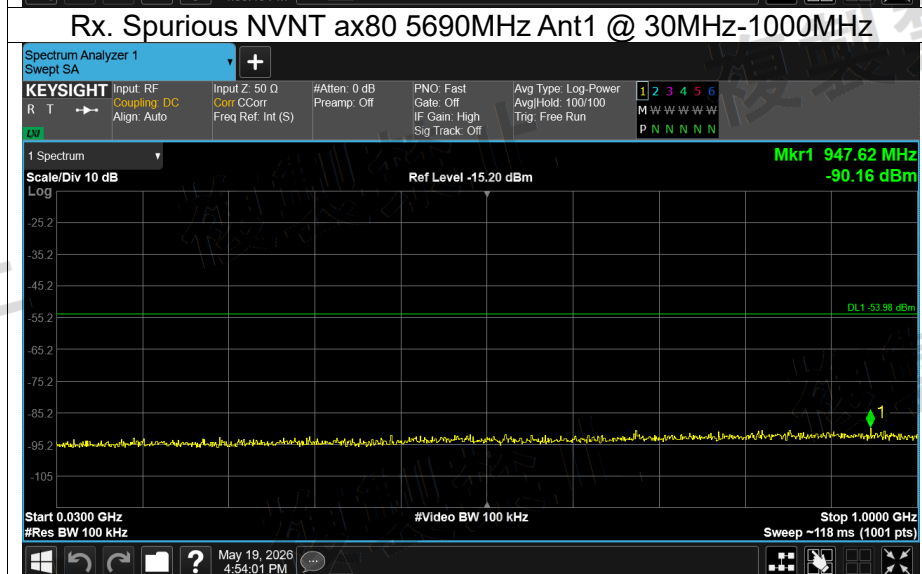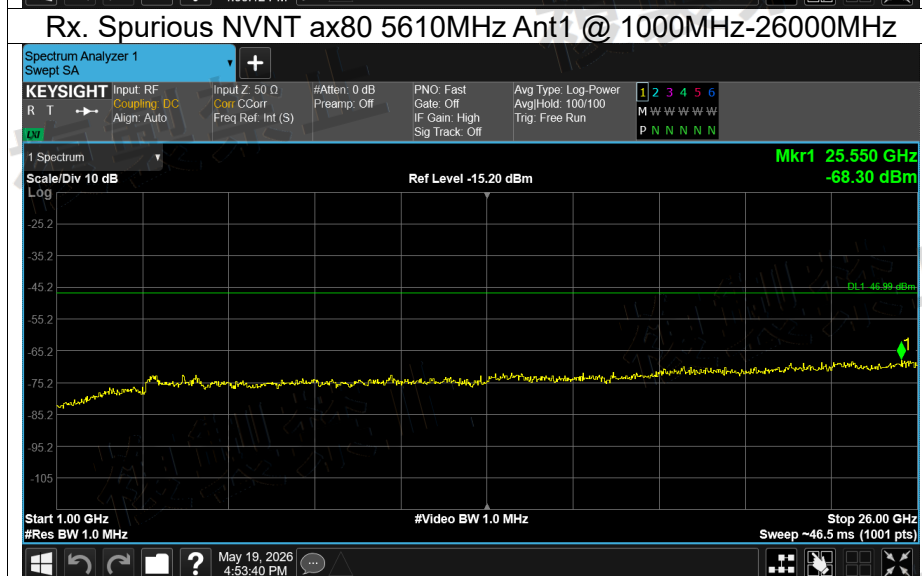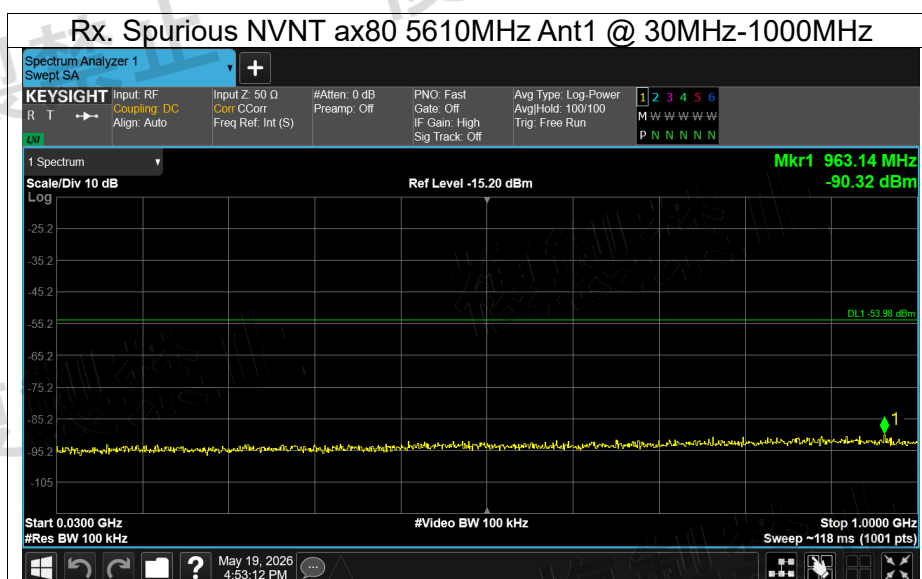

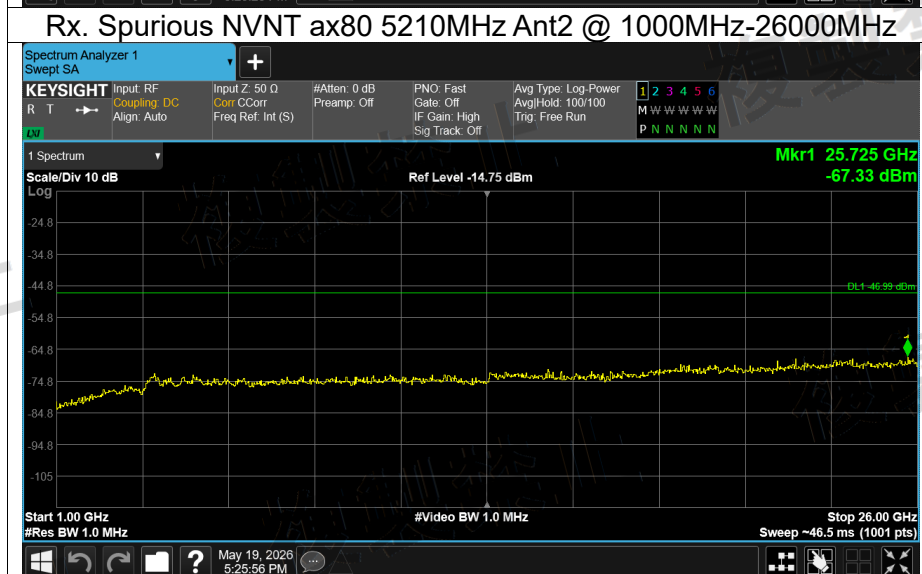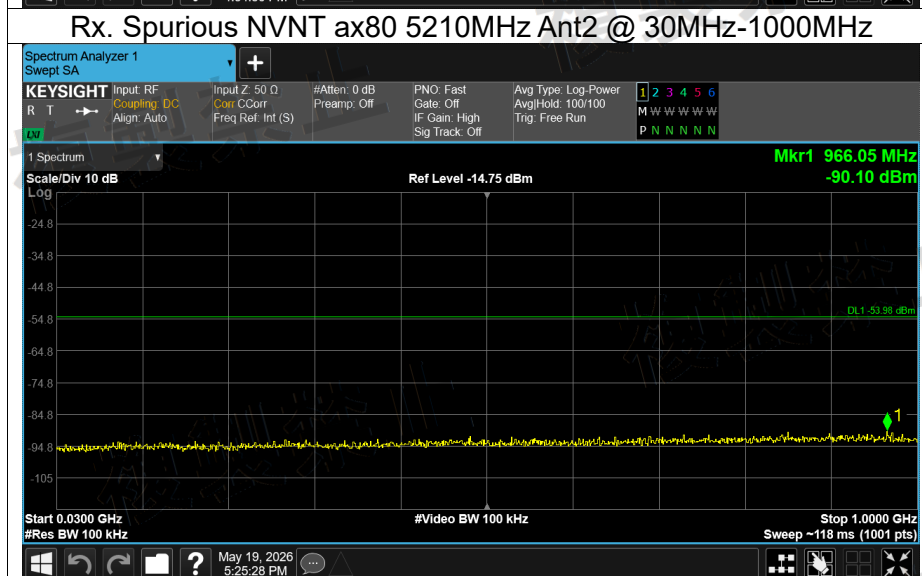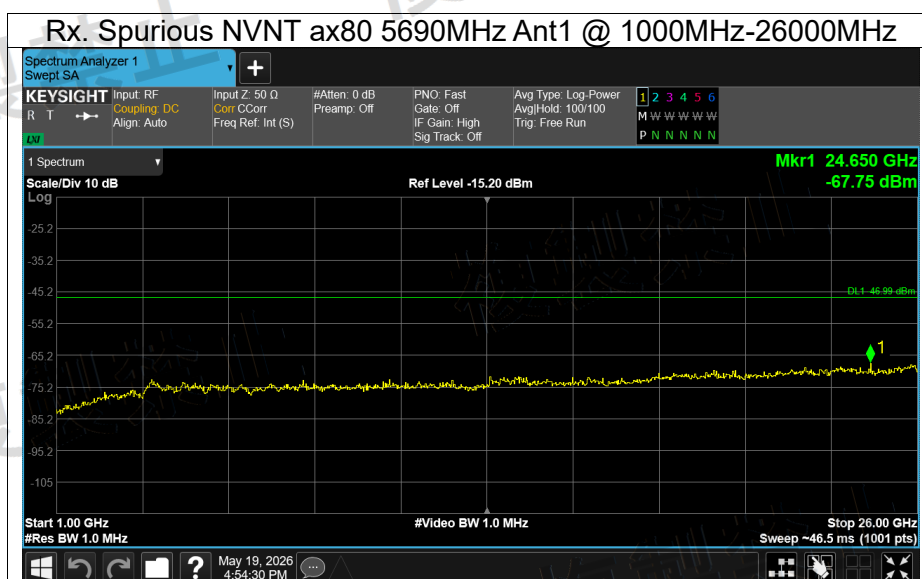

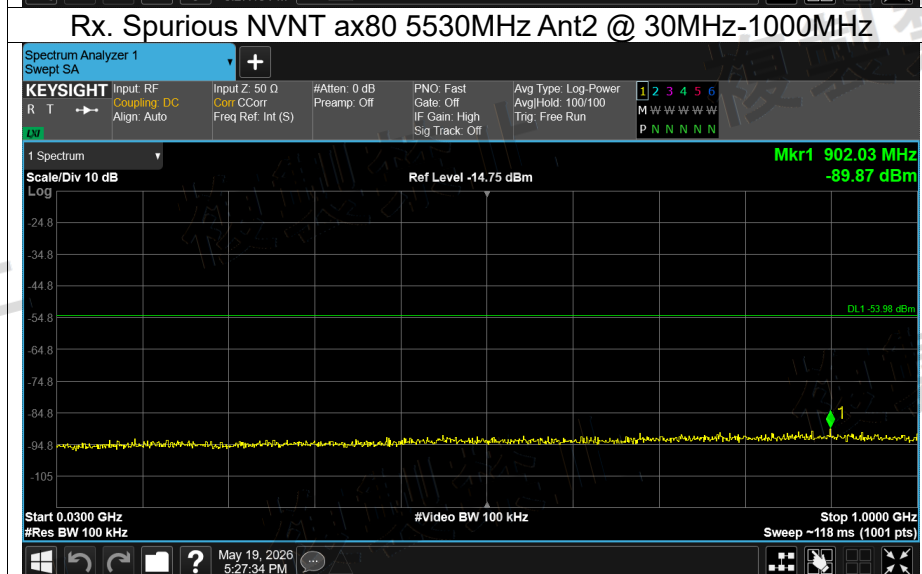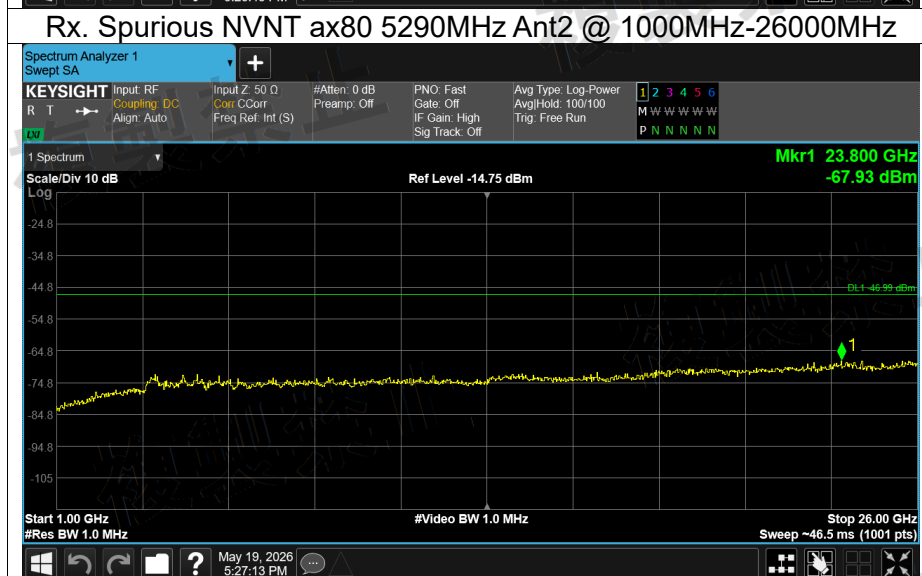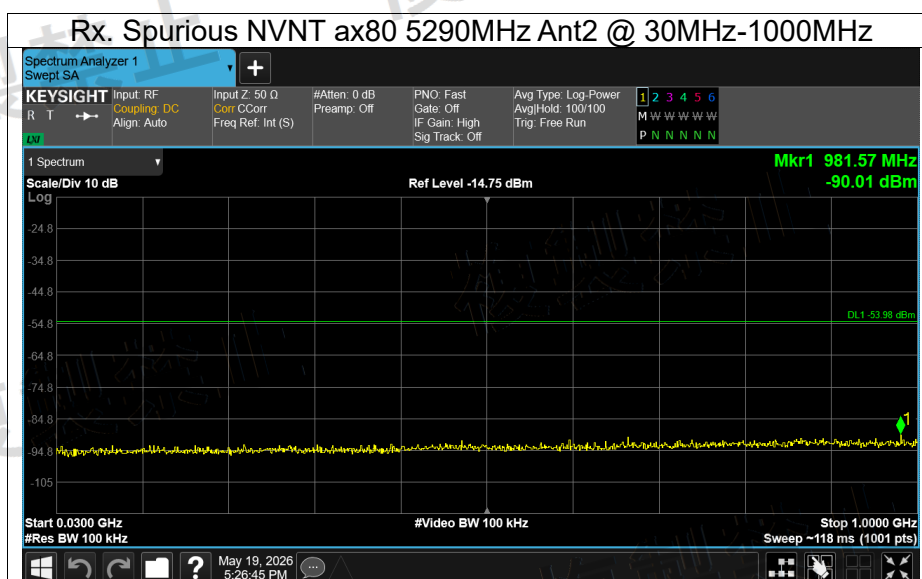

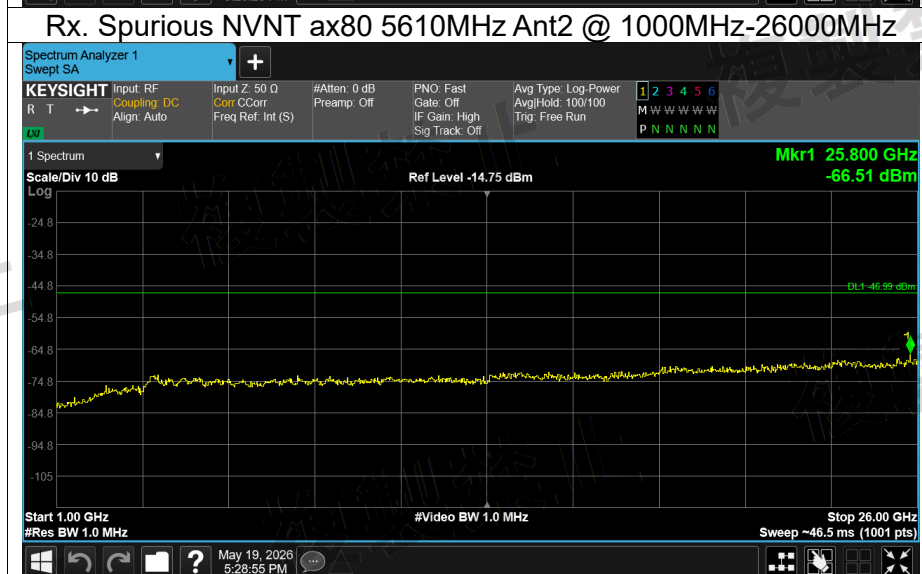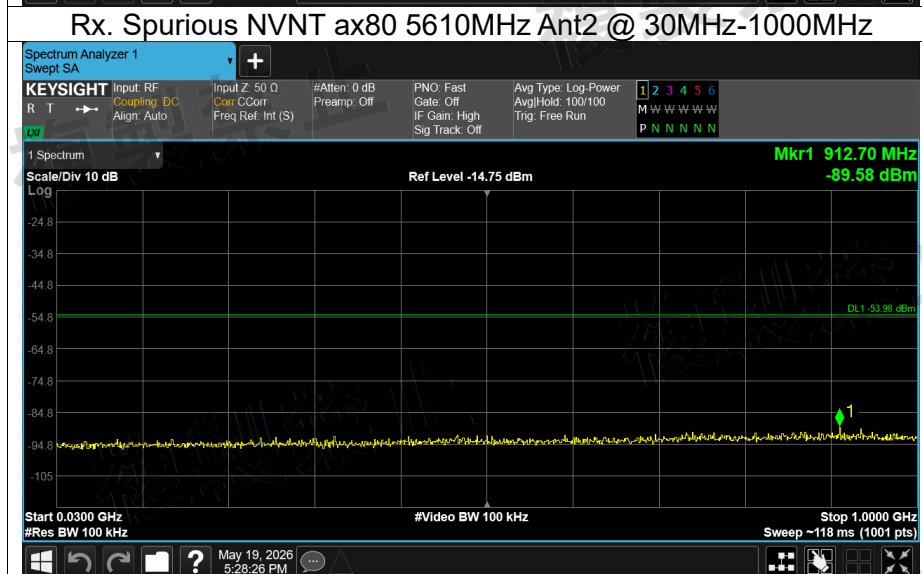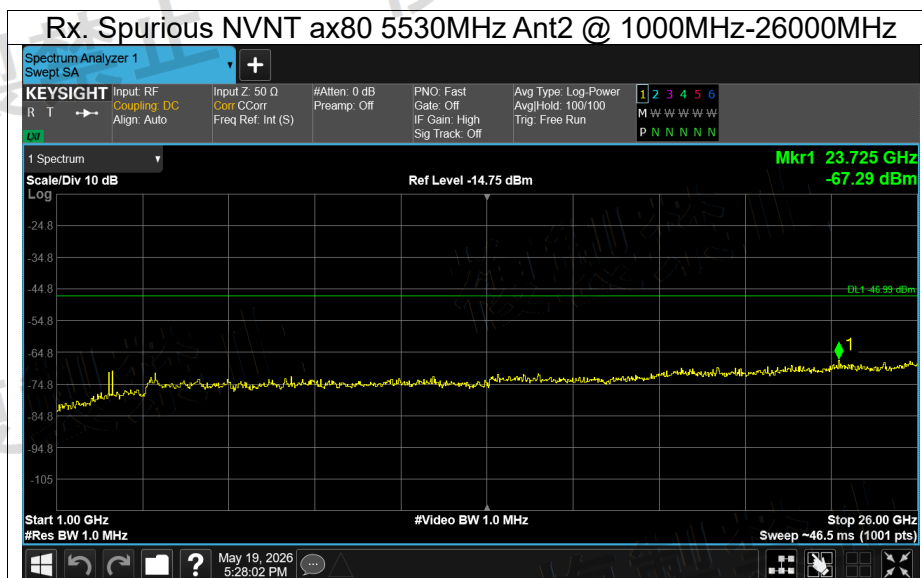

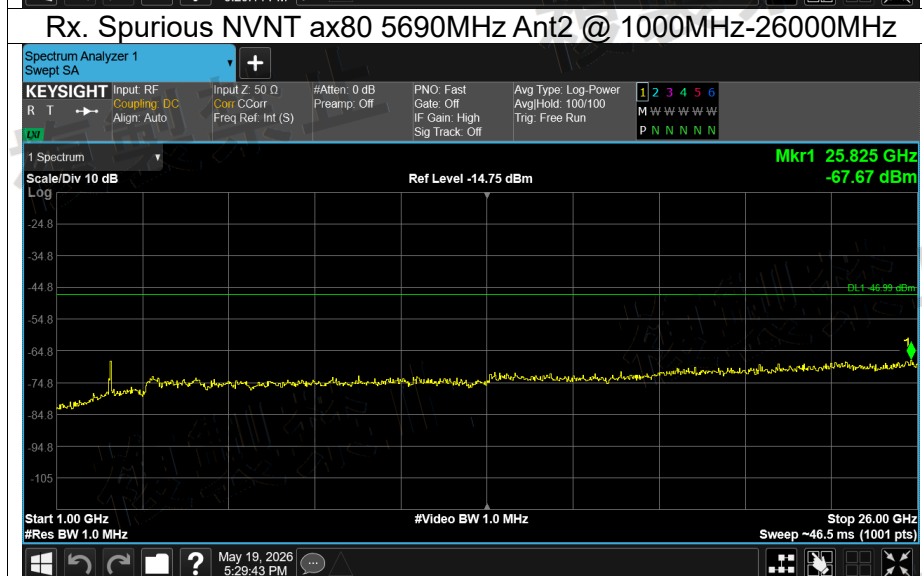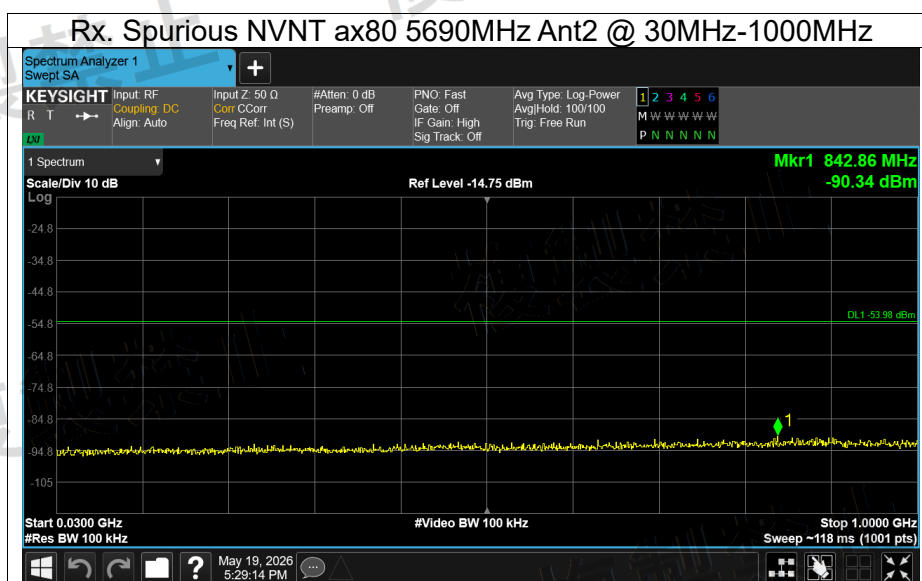



Adjacent Channel Emitted Power

Condition	Mode	Frequency (MHz)	Antenna	Offset (MHz)	Value (dBc)	Limit (dBc)	Verdict
NVNT	a	5180	Ant1	-20	-32.22	-25	Pass
NVNT	a	5180	Ant1	-40	-49.69	-40	Pass
NVNT	a	5180	Ant1	20	-31.64	-25	Pass
NVNT	a	5180	Ant1	40	-48.81	-40	Pass
NVNT	a	5200	Ant1	-20	-32.67	-25	Pass
NVNT	a	5200	Ant1	-40	-49.92	-40	Pass
NVNT	a	5200	Ant1	20	-32.04	-25	Pass
NVNT	a	5200	Ant1	40	-48.97	-40	Pass
NVNT	a	5240	Ant1	-20	-32.5	-25	Pass
NVNT	a	5240	Ant1	-40	-50.11	-40	Pass
NVNT	a	5240	Ant1	20	-32.25	-25	Pass
NVNT	a	5240	Ant1	40	-49.4	-40	Pass
NVNT	a	5260	Ant1	-20	-32.7	-25	Pass
NVNT	a	5260	Ant1	-40	-48.15	-40	Pass
NVNT	a	5260	Ant1	20	-32.09	-25	Pass
NVNT	a	5260	Ant1	40	-48.05	-40	Pass
NVNT	a	5300	Ant1	-20	-32.19	-25	Pass
NVNT	a	5300	Ant1	-40	-48.31	-40	Pass
NVNT	a	5300	Ant1	20	-32.06	-25	Pass
NVNT	a	5300	Ant1	40	-47.88	-40	Pass
NVNT	a	5320	Ant1	-20	-32.69	-25	Pass
NVNT	a	5320	Ant1	-40	-48.51	-40	Pass
NVNT	a	5320	Ant1	20	-31.8	-25	Pass
NVNT	a	5320	Ant1	40	-47.62	-40	Pass
NVNT	a	5500	Ant1	-20	-32.71	-25	Pass
NVNT	a	5500	Ant1	-40	-50.21	-40	Pass
NVNT	a	5500	Ant1	20	-32.67	-25	Pass
NVNT	a	5500	Ant1	40	-49.03	-40	Pass
NVNT	a	5580	Ant1	-20	-31.94	-25	Pass
NVNT	a	5580	Ant1	-40	-50.23	-40	Pass
NVNT	a	5580	Ant1	20	-32.2	-25	Pass
NVNT	a	5580	Ant1	40	-49.74	-40	Pass
NVNT	a	5720	Ant1	-20	-32.35	-25	Pass
NVNT	a	5720	Ant1	-40	-50.32	-40	Pass
NVNT	a	5720	Ant1	20	-32.3	-25	Pass
NVNT	a	5720	Ant1	40	-49.06	-40	Pass
NVNT	a	5180	Ant2	-20	-30.85	-25	Pass
NVNT	a	5180	Ant2	-40	-49.05	-40	Pass
NVNT	a	5180	Ant2	20	-29.65	-25	Pass
NVNT	a	5180	Ant2	40	-48.64	-40	Pass
NVNT	a	5200	Ant2	-20	-32.38	-25	Pass
NVNT	a	5200	Ant2	-40	-49.23	-40	Pass
NVNT	a	5200	Ant2	20	-32.17	-25	Pass
NVNT	a	5200	Ant2	40	-49.63	-40	Pass
NVNT	a	5240	Ant2	-20	-32.47	-25	Pass
NVNT	a	5240	Ant2	-40	-49.58	-40	Pass
NVNT	a	5240	Ant2	20	-32.5	-25	Pass
NVNT	a	5240	Ant2	40	-50.01	-40	Pass
NVNT	a	5260	Ant2	-20	-31.99	-25	Pass
NVNT	a	5260	Ant2	-40	-46.58	-40	Pass
NVNT	a	5260	Ant2	20	-32.58	-25	Pass
NVNT	a	5260	Ant2	40	-47.31	-40	Pass
NVNT	a	5300	Ant2	-20	-32.37	-25	Pass



NVNT	a	5300	Ant2	-40	-46.7	-40	Pass
NVNT	a	5300	Ant2	20	-32.34	-25	Pass
NVNT	a	5300	Ant2	40	-47.5	-40	Pass
NVNT	a	5320	Ant2	-20	-31.88	-25	Pass
NVNT	a	5320	Ant2	-40	-46.94	-40	Pass
NVNT	a	5320	Ant2	20	-32.6	-25	Pass
NVNT	a	5320	Ant2	40	-47.49	-40	Pass
NVNT	a	5500	Ant2	-20	-32.22	-25	Pass
NVNT	a	5500	Ant2	-40	-50.36	-40	Pass
NVNT	a	5500	Ant2	20	-32.04	-25	Pass
NVNT	a	5500	Ant2	40	-49.08	-40	Pass
NVNT	a	5580	Ant2	-20	-32.79	-25	Pass
NVNT	a	5580	Ant2	-40	-50.03	-40	Pass
NVNT	a	5580	Ant2	20	-31.75	-25	Pass
NVNT	a	5580	Ant2	40	-49.35	-40	Pass
NVNT	a	5720	Ant2	-20	-31.99	-25	Pass
NVNT	a	5720	Ant2	-40	-49.73	-40	Pass
NVNT	a	5720	Ant2	20	-32.55	-25	Pass
NVNT	a	5720	Ant2	40	-49.98	-40	Pass
NVNT	n20	5180	Ant1	-20	-31.99	-25	Pass
NVNT	n20	5180	Ant1	-40	-49.46	-40	Pass
NVNT	n20	5180	Ant1	20	-31.32	-25	Pass
NVNT	n20	5180	Ant1	40	-49.1	-40	Pass
NVNT	n20	5200	Ant1	-20	-31.96	-25	Pass
NVNT	n20	5200	Ant1	-40	-49.68	-40	Pass
NVNT	n20	5200	Ant1	20	-31.4	-25	Pass
NVNT	n20	5200	Ant1	40	-49.38	-40	Pass
NVNT	n20	5240	Ant1	-20	-32.29	-25	Pass
NVNT	n20	5240	Ant1	-40	-49.79	-40	Pass
NVNT	n20	5240	Ant1	20	-31.54	-25	Pass
NVNT	n20	5240	Ant1	40	-49.59	-40	Pass
NVNT	n20	5260	Ant1	-20	-31.81	-25	Pass
NVNT	n20	5260	Ant1	-40	-47.78	-40	Pass
NVNT	n20	5260	Ant1	20	-31.76	-25	Pass
NVNT	n20	5260	Ant1	40	-47.99	-40	Pass
NVNT	n20	5300	Ant1	-20	-32.06	-25	Pass
NVNT	n20	5300	Ant1	-40	-47.94	-40	Pass
NVNT	n20	5300	Ant1	20	-31.85	-25	Pass
NVNT	n20	5300	Ant1	40	-47.67	-40	Pass
NVNT	n20	5320	Ant1	-20	-32.06	-25	Pass
NVNT	n20	5320	Ant1	-40	-48.11	-40	Pass
NVNT	n20	5320	Ant1	20	-31.83	-25	Pass
NVNT	n20	5320	Ant1	40	-47.67	-40	Pass
NVNT	n20	5500	Ant1	-20	-31.78	-25	Pass
NVNT	n20	5500	Ant1	-40	-50.56	-40	Pass
NVNT	n20	5500	Ant1	20	-32.28	-25	Pass
NVNT	n20	5500	Ant1	40	-49.35	-40	Pass
NVNT	n20	5580	Ant1	-20	-31.87	-25	Pass
NVNT	n20	5580	Ant1	-40	-50.25	-40	Pass
NVNT	n20	5580	Ant1	20	-31.65	-25	Pass
NVNT	n20	5580	Ant1	40	-49.17	-40	Pass
NVNT	n20	5720	Ant1	-20	-32.13	-25	Pass
NVNT	n20	5720	Ant1	-40	-50.3	-40	Pass
NVNT	n20	5720	Ant1	20	-31.94	-25	Pass
NVNT	n20	5720	Ant1	40	-49.39	-40	Pass
NVNT	n20	5180	Ant2	-20	-32.35	-25	Pass



NVNT	n20	5180	Ant2	-40	-48.42	-40	Pass
NVNT	n20	5180	Ant2	20	-31.36	-25	Pass
NVNT	n20	5180	Ant2	40	-48.71	-40	Pass
NVNT	n20	5200	Ant2	-20	-31.77	-25	Pass
NVNT	n20	5200	Ant2	-40	-48.64	-40	Pass
NVNT	n20	5200	Ant2	20	-31.22	-25	Pass
NVNT	n20	5200	Ant2	40	-49.18	-40	Pass
NVNT	n20	5240	Ant2	-20	-32.11	-25	Pass
NVNT	n20	5240	Ant2	-40	-49.01	-40	Pass
NVNT	n20	5240	Ant2	20	-31.94	-25	Pass
NVNT	n20	5240	Ant2	40	-49.63	-40	Pass
NVNT	n20	5260	Ant2	-20	-31.69	-25	Pass
NVNT	n20	5260	Ant2	-40	-47.17	-40	Pass
NVNT	n20	5260	Ant2	20	-31.79	-25	Pass
NVNT	n20	5260	Ant2	40	-48.02	-40	Pass
NVNT	n20	5300	Ant2	-20	-31.63	-25	Pass
NVNT	n20	5300	Ant2	-40	-47.4	-40	Pass
NVNT	n20	5300	Ant2	20	-32.26	-25	Pass
NVNT	n20	5300	Ant2	40	-48.26	-40	Pass
NVNT	n20	5320	Ant2	-20	-31.52	-25	Pass
NVNT	n20	5320	Ant2	-40	-47.47	-40	Pass
NVNT	n20	5320	Ant2	20	-32.43	-25	Pass
NVNT	n20	5320	Ant2	40	-48.08	-40	Pass
NVNT	n20	5500	Ant2	-20	-31.92	-25	Pass
NVNT	n20	5500	Ant2	-40	-50.41	-40	Pass
NVNT	n20	5500	Ant2	20	-31.38	-25	Pass
NVNT	n20	5500	Ant2	40	-49.12	-40	Pass
NVNT	n20	5580	Ant2	-20	-32.29	-25	Pass
NVNT	n20	5580	Ant2	-40	-50.18	-40	Pass
NVNT	n20	5580	Ant2	20	-31.46	-25	Pass
NVNT	n20	5580	Ant2	40	-49.46	-40	Pass
NVNT	n20	5720	Ant2	-20	-31.48	-25	Pass
NVNT	n20	5720	Ant2	-40	-50.05	-40	Pass
NVNT	n20	5720	Ant2	20	-31.85	-25	Pass
NVNT	n20	5720	Ant2	40	-50.08	-40	Pass
NVNT	n40	5190	Ant1	-40	-33.44	-25	Pass
NVNT	n40	5190	Ant1	-80	-46.2	-40	Pass
NVNT	n40	5190	Ant1	40	-33.47	-25	Pass
NVNT	n40	5190	Ant1	80	-47.75	-40	Pass
NVNT	n40	5230	Ant1	-40	-33.75	-25	Pass
NVNT	n40	5230	Ant1	-80	-46.46	-40	Pass
NVNT	n40	5230	Ant1	40	-33.26	-25	Pass
NVNT	n40	5230	Ant1	80	-47.84	-40	Pass
NVNT	n40	5270	Ant1	-40	-33.72	-25	Pass
NVNT	n40	5270	Ant1	-80	-43.95	-40	Pass
NVNT	n40	5270	Ant1	40	-33.12	-25	Pass
NVNT	n40	5270	Ant1	80	-44.87	-40	Pass
NVNT	n40	5310	Ant1	-40	-33.3	-25	Pass
NVNT	n40	5310	Ant1	-80	-44.34	-40	Pass
NVNT	n40	5310	Ant1	40	-33.24	-25	Pass
NVNT	n40	5310	Ant1	80	-44.65	-40	Pass
NVNT	n40	5510	Ant1	-40	-33.5	-25	Pass
NVNT	n40	5510	Ant1	-80	-47.78	-40	Pass
NVNT	n40	5510	Ant1	40	-33.32	-25	Pass
NVNT	n40	5510	Ant1	80	-46.99	-40	Pass
NVNT	n40	5550	Ant1	-40	-33.76	-25	Pass



NVNT	n40	5550	Ant1	-80	-47.78	-40	Pass
NVNT	n40	5550	Ant1	40	-33.32	-25	Pass
NVNT	n40	5550	Ant1	80	-47.47	-40	Pass
NVNT	n40	5710	Ant1	-40	-33.57	-25	Pass
NVNT	n40	5710	Ant1	-80	-47.3	-40	Pass
NVNT	n40	5710	Ant1	40	-33.54	-25	Pass
NVNT	n40	5710	Ant1	80	-47.53	-40	Pass
NVNT	n40	5190	Ant2	-40	-33.36	-25	Pass
NVNT	n40	5190	Ant2	-80	-45.73	-40	Pass
NVNT	n40	5190	Ant2	40	-32.71	-25	Pass
NVNT	n40	5190	Ant2	80	-47.03	-40	Pass
NVNT	n40	5230	Ant2	-40	-33.7	-25	Pass
NVNT	n40	5230	Ant2	-80	-46.08	-40	Pass
NVNT	n40	5230	Ant2	40	-33.59	-25	Pass
NVNT	n40	5230	Ant2	80	-47.73	-40	Pass
NVNT	n40	5270	Ant2	-40	-32.81	-25	Pass
NVNT	n40	5270	Ant2	-80	-44.62	-40	Pass
NVNT	n40	5270	Ant2	40	-33.55	-25	Pass
NVNT	n40	5270	Ant2	80	-46.33	-40	Pass
NVNT	n40	5310	Ant2	-40	-33.69	-25	Pass
NVNT	n40	5310	Ant2	-80	-44.17	-40	Pass
NVNT	n40	5310	Ant2	40	-32.09	-25	Pass
NVNT	n40	5310	Ant2	80	-45.3	-40	Pass
NVNT	n40	5510	Ant2	-40	-33.84	-25	Pass
NVNT	n40	5510	Ant2	-80	-46.7	-40	Pass
NVNT	n40	5510	Ant2	40	-33.28	-25	Pass
NVNT	n40	5510	Ant2	80	-45.62	-40	Pass
NVNT	n40	5550	Ant2	-40	-33.72	-25	Pass
NVNT	n40	5550	Ant2	-80	-46.71	-40	Pass
NVNT	n40	5550	Ant2	40	-33.43	-25	Pass
NVNT	n40	5550	Ant2	80	-45.88	-40	Pass
NVNT	n40	5710	Ant2	-40	-33.15	-25	Pass
NVNT	n40	5710	Ant2	-80	-45.97	-40	Pass
NVNT	n40	5710	Ant2	40	-33.85	-25	Pass
NVNT	n40	5710	Ant2	80	-46.6	-40	Pass
NVNT	ac80	5210	Ant1	-80	-33.89	-25	Pass
NVNT	ac80	5210	Ant1	-160	-43.64	-40	Pass
NVNT	ac80	5210	Ant1	80	-34.2	-25	Pass
NVNT	ac80	5210	Ant1	160	-45.15	-40	Pass
NVNT	ac80	5290	Ant1	-80	-33.61	-25	Pass
NVNT	ac80	5290	Ant1	-160	-42.12	-40	Pass
NVNT	ac80	5290	Ant1	80	-34.11	-25	Pass
NVNT	ac80	5290	Ant1	160	-43.35	-40	Pass
NVNT	ac80	5530	Ant1	-80	-33.62	-25	Pass
NVNT	ac80	5530	Ant1	-160	-44.2	-40	Pass
NVNT	ac80	5530	Ant1	80	-33.96	-25	Pass
NVNT	ac80	5530	Ant1	160	-43.36	-40	Pass
NVNT	ac80	5610	Ant1	-80	-33.97	-25	Pass
NVNT	ac80	5610	Ant1	-160	-43.99	-40	Pass
NVNT	ac80	5610	Ant1	80	-34.11	-25	Pass
NVNT	ac80	5610	Ant1	160	-43.78	-40	Pass
NVNT	ac80	5690	Ant1	-80	-33.41	-25	Pass
NVNT	ac80	5690	Ant1	-160	-43.38	-40	Pass
NVNT	ac80	5690	Ant1	80	-34.03	-25	Pass
NVNT	ac80	5690	Ant1	160	-43.43	-40	Pass
NVNT	ac80	5210	Ant2	-80	-33.63	-25	Pass



NVNT	ac80	5210	Ant2	-160	-41.84	-40	Pass
NVNT	ac80	5210	Ant2	80	-33.62	-25	Pass
NVNT	ac80	5210	Ant2	160	-43.67	-40	Pass
NVNT	ac80	5290	Ant2	-80	-33.37	-25	Pass
NVNT	ac80	5290	Ant2	-160	-41.71	-40	Pass
NVNT	ac80	5290	Ant2	80	-34.48	-25	Pass
NVNT	ac80	5290	Ant2	160	-43.41	-40	Pass
NVNT	ac80	5530	Ant2	-80	-34.29	-25	Pass
NVNT	ac80	5530	Ant2	-160	-44.38	-40	Pass
NVNT	ac80	5530	Ant2	80	-33.34	-25	Pass
NVNT	ac80	5530	Ant2	160	-43.4	-40	Pass
NVNT	ac80	5610	Ant2	-80	-34.03	-25	Pass
NVNT	ac80	5610	Ant2	-160	-44.24	-40	Pass
NVNT	ac80	5610	Ant2	80	-33.5	-25	Pass
NVNT	ac80	5610	Ant2	160	-44.05	-40	Pass
NVNT	ac80	5690	Ant2	-80	-33.15	-25	Pass
NVNT	ac80	5690	Ant2	-160	-43.39	-40	Pass
NVNT	ac80	5690	Ant2	80	-34	-25	Pass
NVNT	ac80	5690	Ant2	160	-43.71	-40	Pass
NVNT	ax80	5210	Ant1	-80	-34.28	-25	Pass
NVNT	ax80	5210	Ant1	-160	-42.94	-40	Pass
NVNT	ax80	5210	Ant1	80	-34.8	-25	Pass
NVNT	ax80	5210	Ant1	160	-44.44	-40	Pass
NVNT	ax80	5290	Ant1	-80	-34.85	-25	Pass
NVNT	ax80	5290	Ant1	-160	-41.35	-40	Pass
NVNT	ax80	5290	Ant1	80	-35.09	-25	Pass
NVNT	ax80	5290	Ant1	160	-42.69	-40	Pass
NVNT	ax80	5530	Ant1	-80	-34.98	-25	Pass
NVNT	ax80	5530	Ant1	-160	-43.48	-40	Pass
NVNT	ax80	5530	Ant1	80	-34.52	-25	Pass
NVNT	ax80	5530	Ant1	160	-42.67	-40	Pass
NVNT	ax80	5610	Ant1	-80	-34.76	-25	Pass
NVNT	ax80	5610	Ant1	-160	-43.36	-40	Pass
NVNT	ax80	5610	Ant1	80	-34.73	-25	Pass
NVNT	ax80	5610	Ant1	160	-43.08	-40	Pass
NVNT	ax80	5690	Ant1	-80	-34.88	-25	Pass
NVNT	ax80	5690	Ant1	-160	-42.89	-40	Pass
NVNT	ax80	5690	Ant1	80	-35.13	-25	Pass
NVNT	ax80	5690	Ant1	160	-42.77	-40	Pass
NVNT	ax80	5210	Ant2	-80	-34.52	-25	Pass
NVNT	ax80	5210	Ant2	-160	-42.29	-40	Pass
NVNT	ax80	5210	Ant2	80	-34.92	-25	Pass
NVNT	ax80	5210	Ant2	160	-44.21	-40	Pass
NVNT	ax80	5290	Ant2	-80	-33.68	-25	Pass
NVNT	ax80	5290	Ant2	-160	-40.13	-40	Pass
NVNT	ax80	5290	Ant2	80	-35.12	-25	Pass
NVNT	ax80	5290	Ant2	160	-41.76	-40	Pass
NVNT	ax80	5530	Ant2	-80	-34.71	-25	Pass
NVNT	ax80	5530	Ant2	-160	-42.97	-40	Pass
NVNT	ax80	5530	Ant2	80	-34.09	-25	Pass
NVNT	ax80	5530	Ant2	160	-41.95	-40	Pass
NVNT	ax80	5610	Ant2	-80	-34.42	-25	Pass
NVNT	ax80	5610	Ant2	-160	-42.96	-40	Pass
NVNT	ax80	5610	Ant2	80	-34.63	-25	Pass
NVNT	ax80	5610	Ant2	160	-42.74	-40	Pass
NVNT	ax80	5690	Ant2	-80	-33.98	-25	Pass



NVNT	ax80	5690	Ant2	-160	-42.13	-40	Pass
NVNT	ax80	5690	Ant2	80	-34.99	-25	Pass
NVNT	ax80	5690	Ant2	160	-42.22	-40	Pass

