




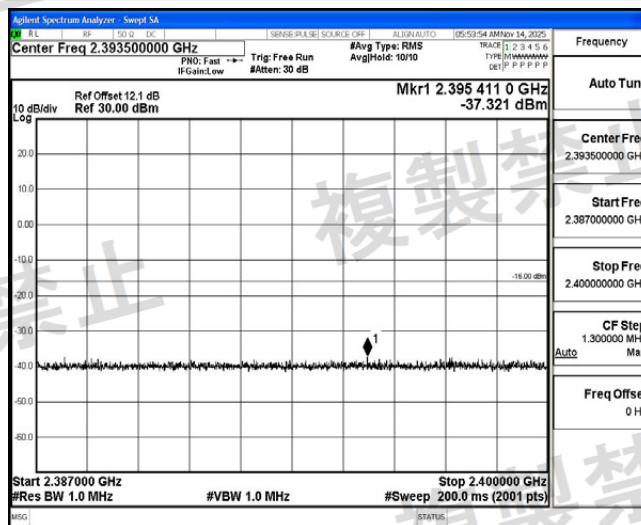


NTHV_DH5_Ant1_2480_2483.5~2496.5

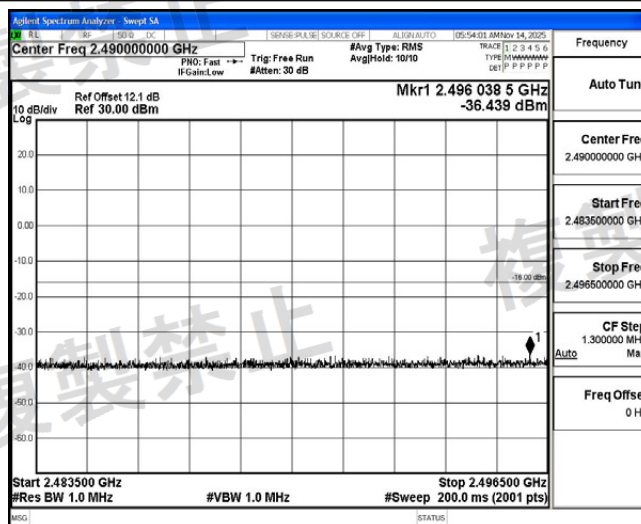


NTHV_DH5_Ant1_2480_2496.5~13000

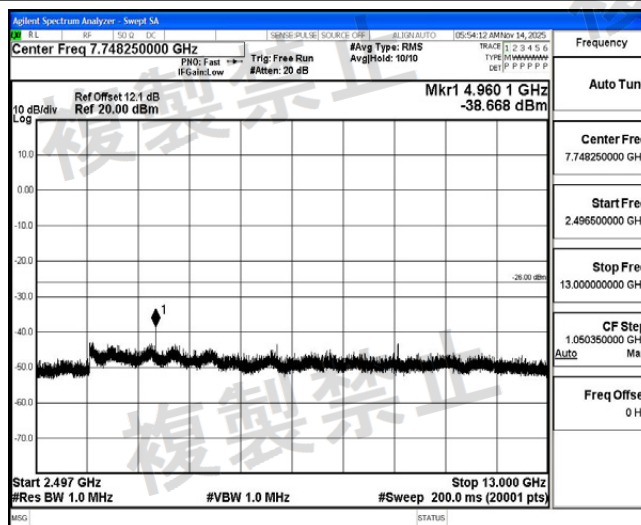


NTHV_2DH5_Ant1_2402_30~1000

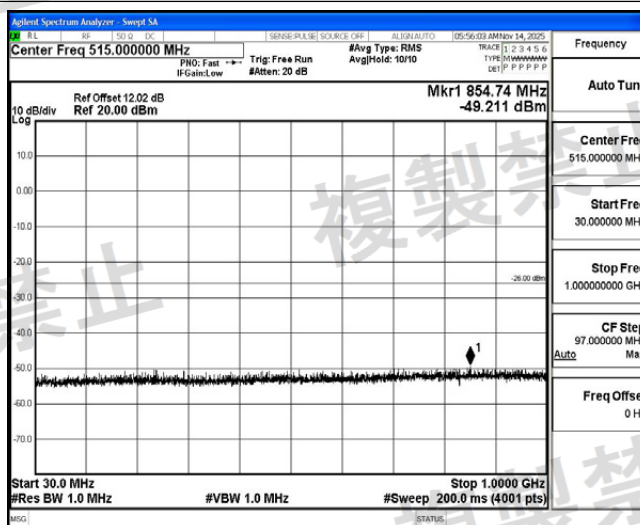


NTHV_2DH5_Ant1_2402_1000~2387

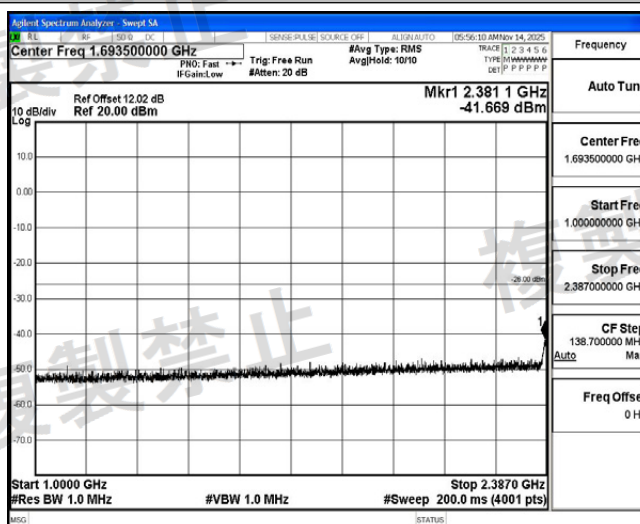


NTHV_2DH5_Ant1_2402_2387~2400

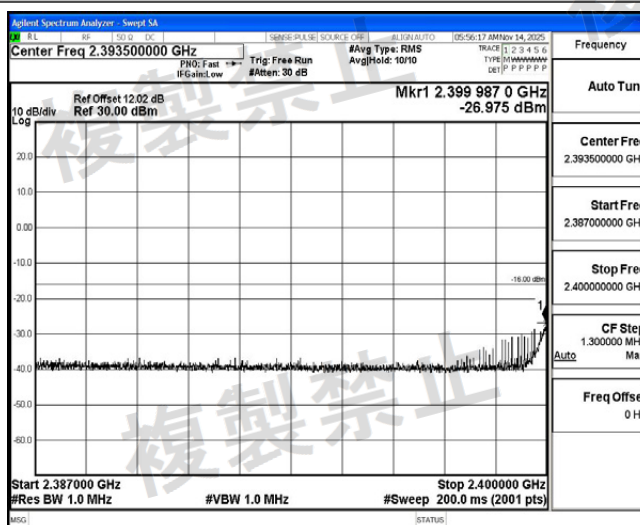


NTHV_2DH5_Ant1_2402_2483.5~2496.5

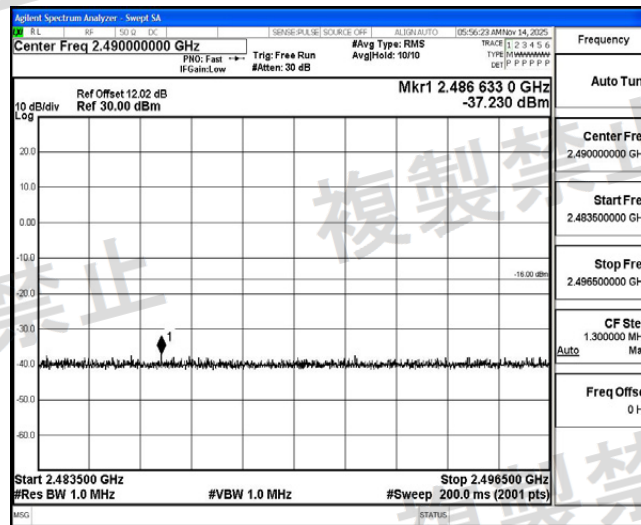


NTHV_2DH5_Ant1_2402_2496.5~13000

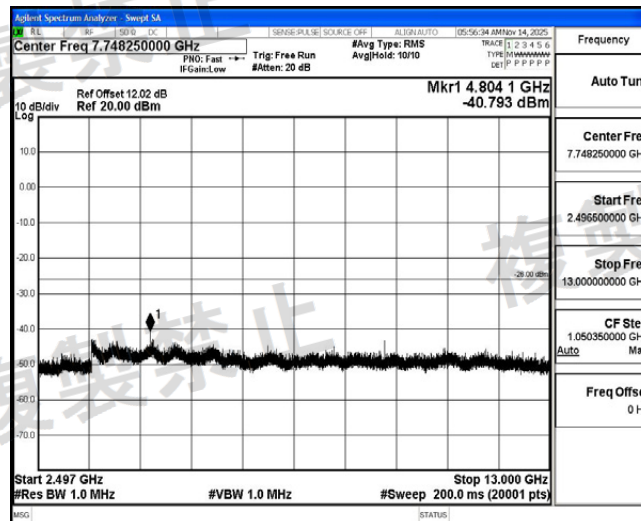


NTHV_2DH5_Ant1_2441_30~1000

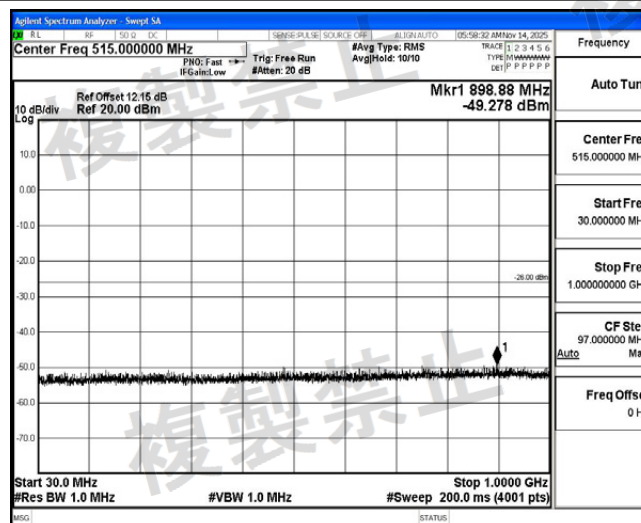


NTHV_2DH5_Ant1_2441_1000~2387

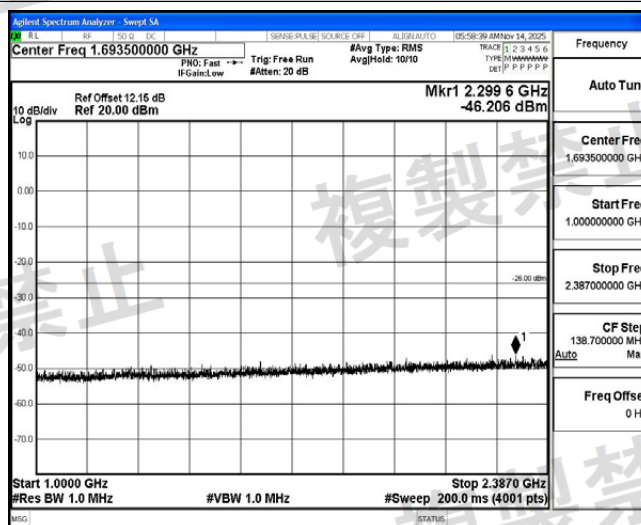


NTHV_2DH5_Ant1_2441_2387~2400

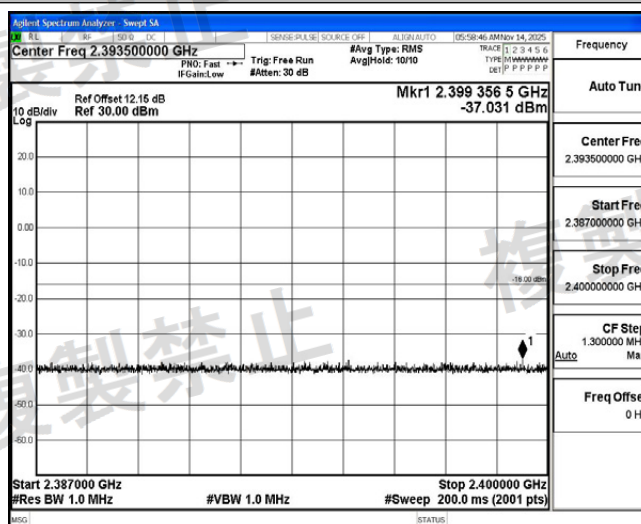


NTHV_2DH5_Ant1_2441_2483.5~2496.5

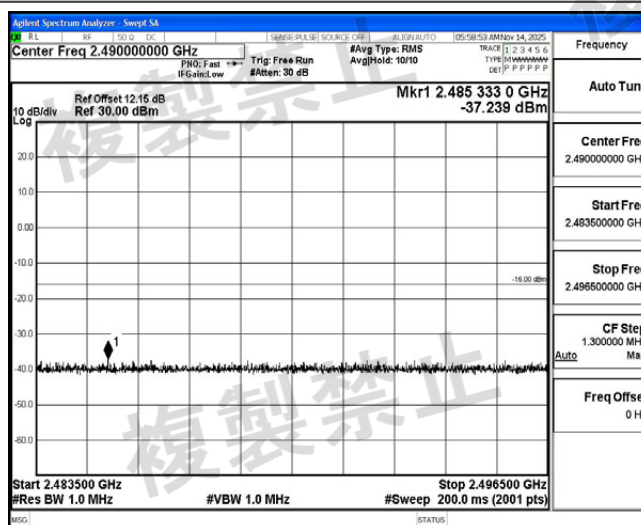


NTHV_2DH5_Ant1_2441_2496.5~13000

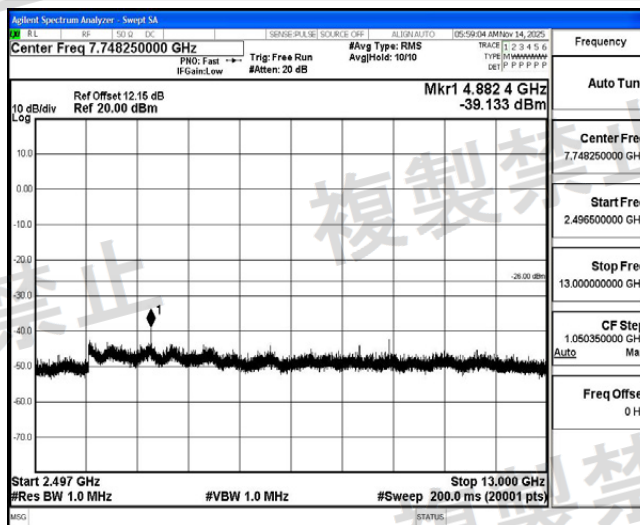


NTHV_2DH5_Ant1_2480_30~1000

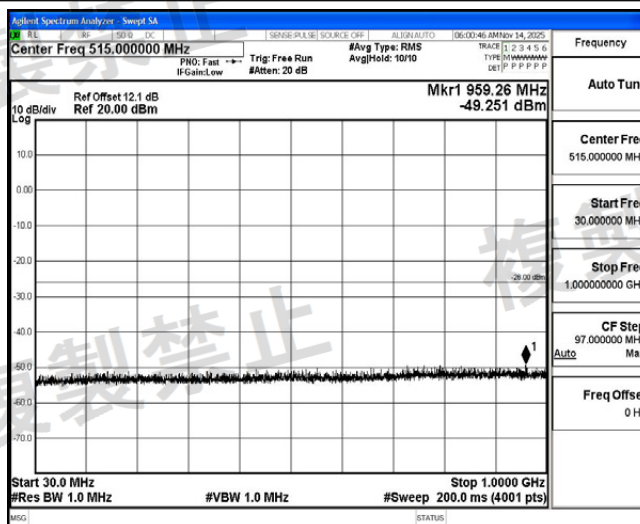


NTHV_2DH5_Ant1_2480_1000~2387

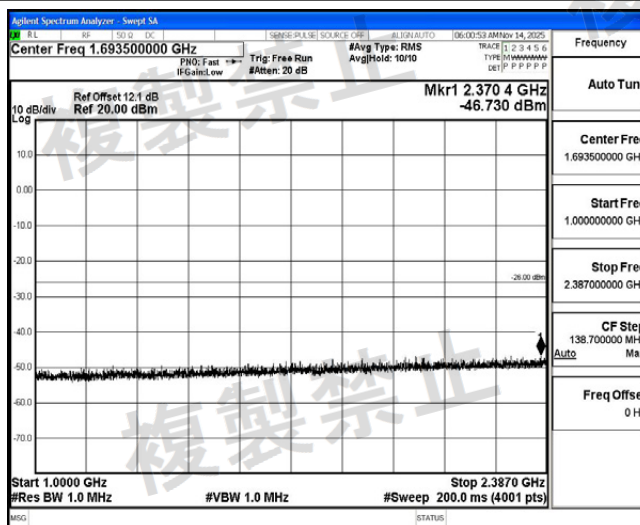


NTHV_2DH5_Ant1_2480_2387~2400

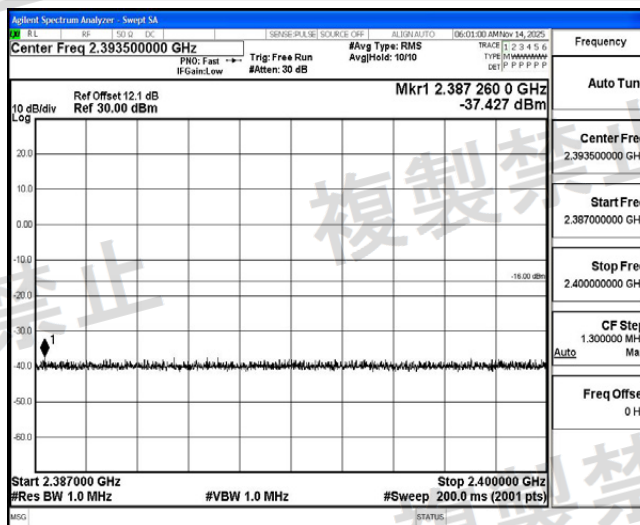


NTHV_2DH5_Ant1_2480_2483.5~2496.5

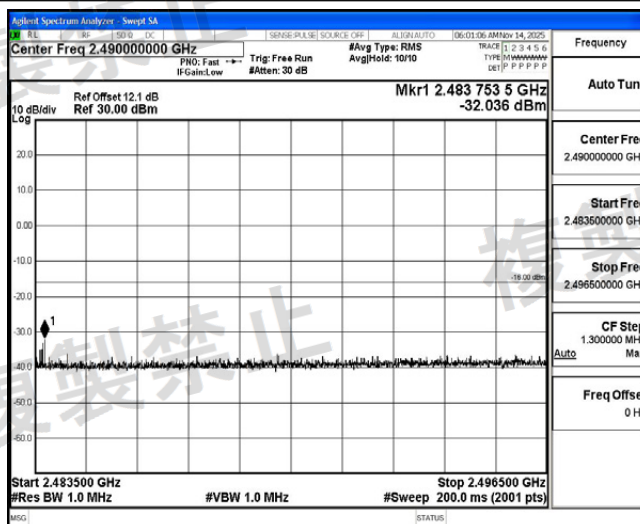


NTHV_2DH5_Ant1_2480_2496.5~13000

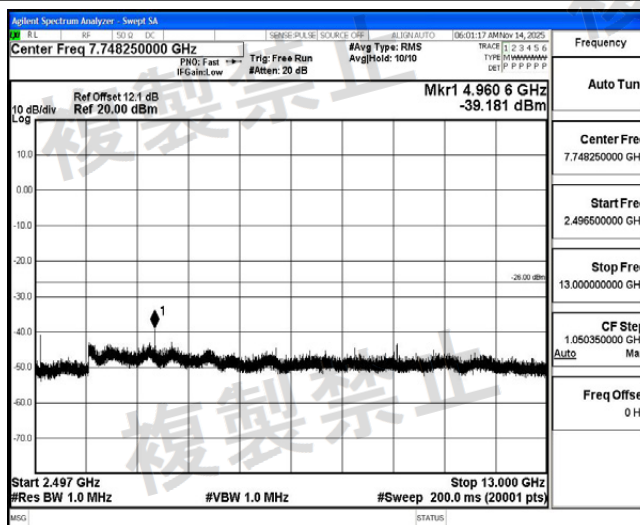


NTHV_3DH5_Ant1_2402_30~1000

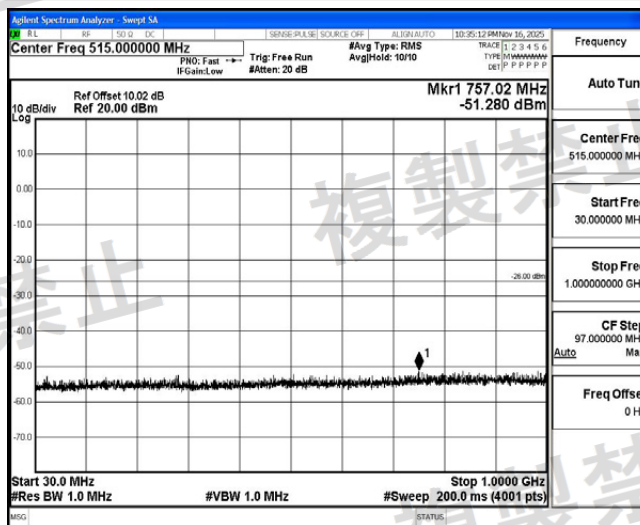


NTHV_3DH5_Ant1_2402_1000~2387

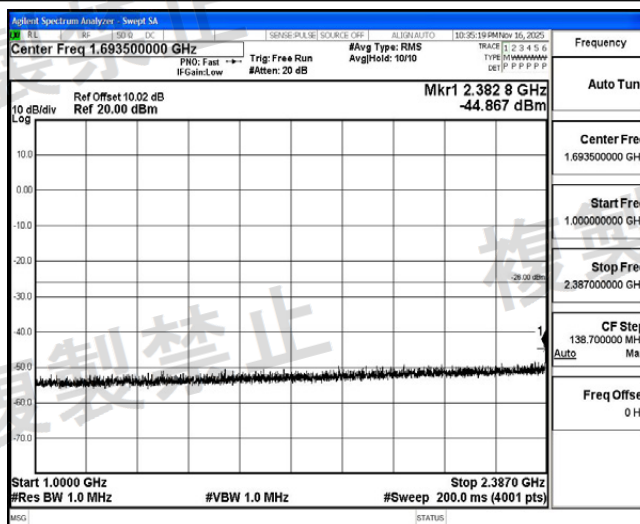


NTHV_3DH5_Ant1_2402_2387~2400

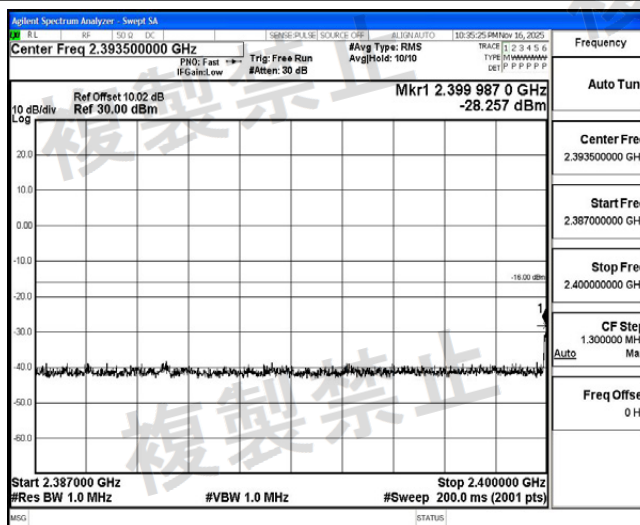


NTHV_3DH5_Ant1_2402_2483.5~2496.5

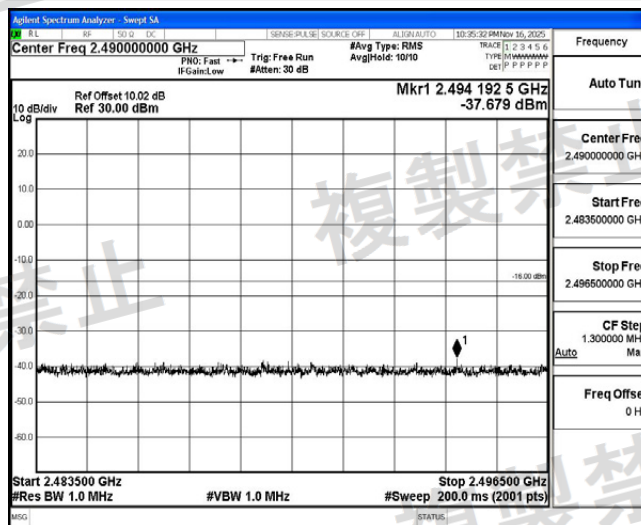


NTHV_3DH5_Ant1_2402_2496.5~13000

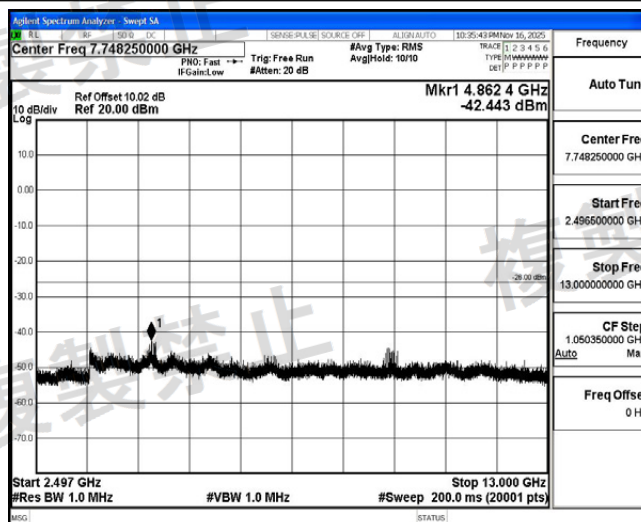


NTHV_3DH5_Ant1_2441_30~1000

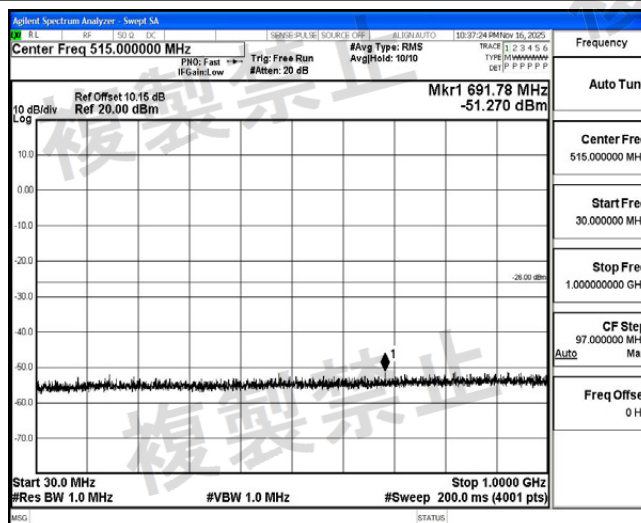


NTHV_3DH5_Ant1_2441_1000~2387

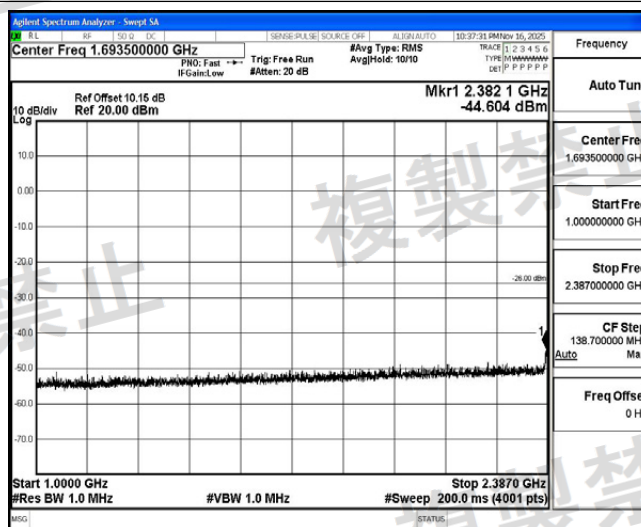


NTHV_3DH5_Ant1_2441_2387~2400

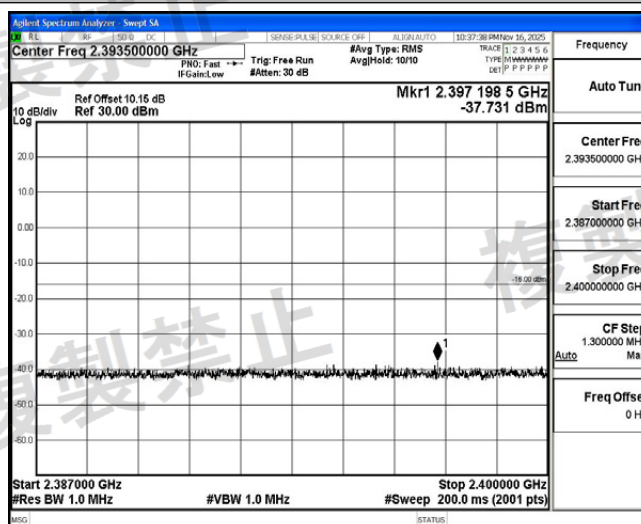


NTHV_3DH5_Ant1_2441_2483.5~2496.5

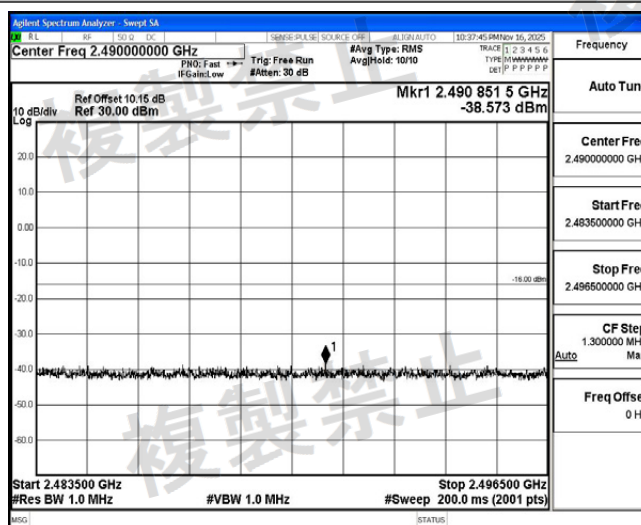


NTHV_3DH5_Ant1_2441_2496.5~13000

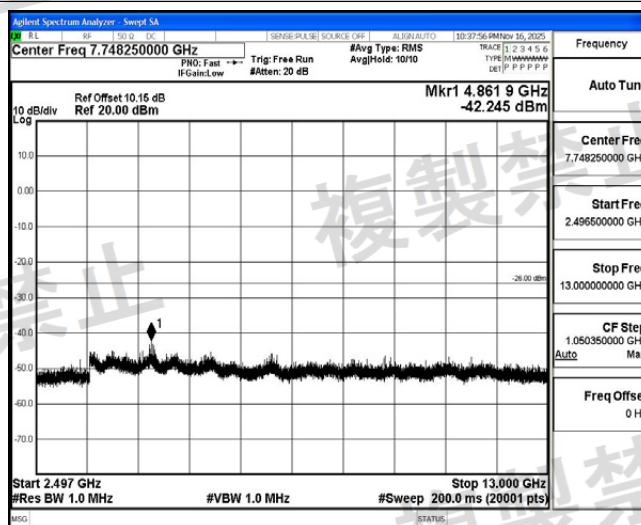


NTHV_3DH5_Ant1_2480_30~1000

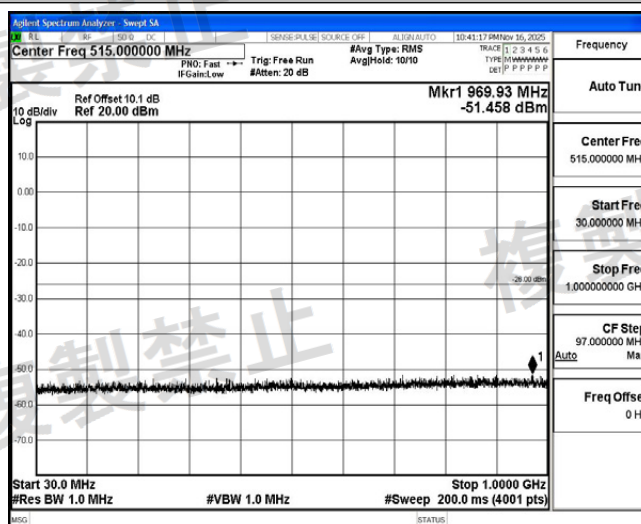


NTHV_3DH5_Ant1_2480_1000~2387

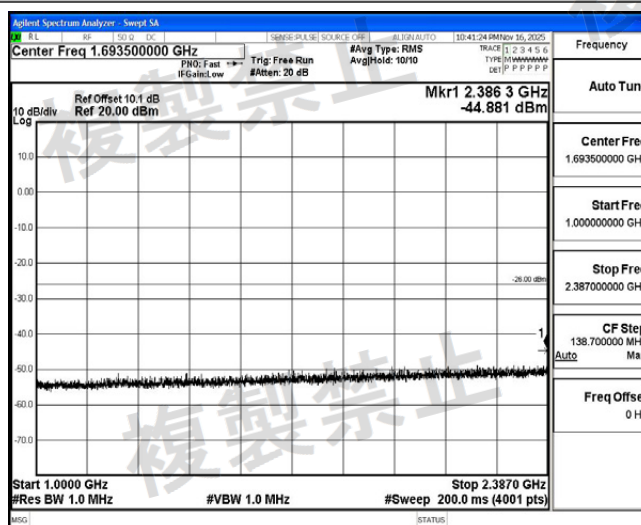


NTHV_3DH5_Ant1_2480_2387~2400

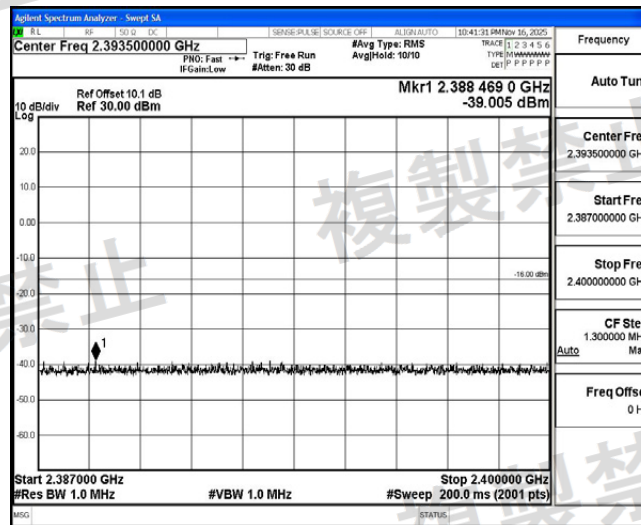

NTHV_3DH5_Ant1_2480_2483.5~2496.5

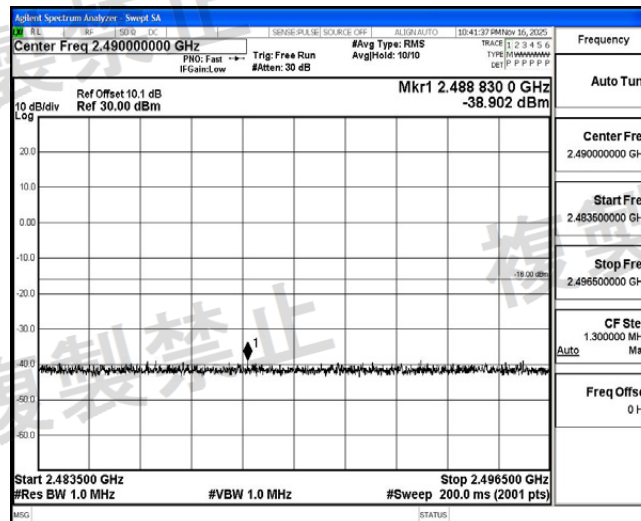

NTHV_3DH5_Ant1_2480_2496.5~13000

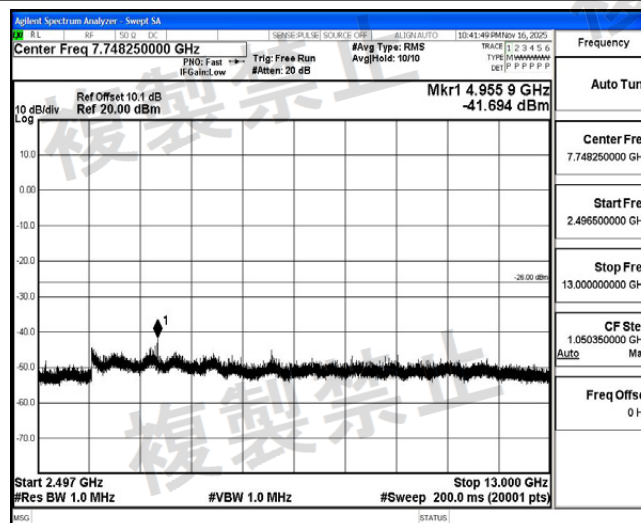

Note: SA set to from 2.4965GHz to 13GHz, plot shows from 2.497GHz to 13GHz as of SA's default format.

Dongguan DN Testing Co., Ltd.

**Appendix G: Spurious Emission of RX****Test Result**

Test Condition	Test Mode	Antenna	Freq(M Hz)	Freq.Range [MHz]	Freq. [MHz]	Result [dBm]	Limit [dBm]	Result [nW]	Limit [nW]	Verdict
NTNV	DH5	Ant1	2402	30~1000	905.43	-79.60	≤-54	0.01096	≤4	PASS
				1000~12500	5202.68	-63.01	≤-47	0.50003	≤20	PASS
			2441	30~1000	922.89	-80.09	≤-54	0.00979	≤4	PASS
				1000~12500	3609.35	-62.85	≤-47	0.51880	≤20	PASS
			2480	30~1000	687.18	-80.42	≤-54	0.00908	≤4	PASS
				1000~12500	3603.03	-62.54	≤-47	0.55719	≤20	PASS
	2DH5	Ant1	2402	30~1000	922.40	-79.84	≤-54	0.01038	≤4	PASS
				1000~12500	3677.78	-63.13	≤-47	0.48641	≤20	PASS
			2441	30~1000	811.82	-80.09	≤-54	0.00979	≤4	PASS
				1000~12500	4732.90	-63.01	≤-47	0.50003	≤20	PASS
			2480	30~1000	964.11	-80.28	≤-54	0.00938	≤4	PASS
				1000~12500	3637.53	-62.81	≤-47	0.52360	≤20	PASS
	3DH5	Ant1	2402	30~1000	850.14	-79.73	≤-54	0.01064	≤4	PASS
				1000~12500	3615.10	-63.52	≤-47	0.44463	≤20	PASS
			2441	30~1000	779.81	-80.76	≤-54	0.00839	≤4	PASS
				1000~12500	4833.53	-62.54	≤-47	0.55719	≤20	PASS
			2480	30~1000	914.64	-80.54	≤-54	0.00883	≤4	PASS
				1000~12500	3600.15	-62.11	≤-47	0.61518	≤20	PASS
NTLV	DH5	Ant1	2402	30~1000	833.65	-80.61	≤-54	0.00869	≤4	PASS
				1000~12500	3602.45	-62.55	≤-47	0.55590	≤20	PASS
			2441	30~1000	878.27	-79.43	≤-54	0.01140	≤4	PASS
				1000~12500	3613.95	-63.14	≤-47	0.48529	≤20	PASS
			2480	30~1000	878.75	-80.25	≤-54	0.00944	≤4	PASS
				1000~12500	3623.15	-62.54	≤-47	0.55719	≤20	PASS
	2DH5	Ant1	2402	30~1000	739.56	-80.62	≤-54	0.00867	≤4	PASS
				1000~12500	3612.23	-62.79	≤-47	0.52602	≤20	PASS
			2441	30~1000	857.41	-79.05	≤-54	0.01245	≤4	PASS
				1000~12500	4034.28	-62.77	≤-47	0.52845	≤20	PASS
			2480	30~1000	830.25	-79.07	≤-54	0.01239	≤4	PASS
				1000~12500	3709.40	-61.83	≤-47	0.65615	≤20	PASS
	3DH5	Ant1	2402	30~1000	964.60	-80.88	≤-54	0.00817	≤4	PASS
				1000~12500	3600.15	-63.10	≤-47	0.48978	≤20	PASS
			2441	30~1000	976.72	-79.71	≤-54	0.01069	≤4	PASS
				1000~12500	3970.45	-63.09	≤-47	0.49091	≤20	PASS
			2480	30~1000	903.97	-80.71	≤-54	0.00849	≤4	PASS
				1000~12500	3626.60	-62.33	≤-47	0.58479	≤20	PASS
NTHV	DH5	Ant1	2402	30~1000	749.26	-80.47	≤-54	0.00897	≤4	PASS
				1000~12500	3676.05	-62.58	≤-47	0.55208	≤20	PASS

Dongguan DN Testing Co., Ltd.




		2441	30~1000	941.80	-79.40	≤ -54	0.01148	≤ 4	PASS
			1000~12500	4859.40	-63.06	≤ -47	0.49431	≤ 20	PASS
		2480	30~1000	741.98	-80.14	≤ -54	0.00968	≤ 4	PASS
			1000~12500	3666.85	-62.89	≤ -47	0.51404	≤ 20	PASS
	2DH5	2402	30~1000	943.74	-80.74	≤ -54	0.00843	≤ 4	PASS
			1000~12500	3608.20	-62.51	≤ -47	0.56105	≤ 20	PASS
		2441	30~1000	884.09	-80.26	≤ -54	0.00942	≤ 4	PASS
			1000~12500	4837.55	-62.13	≤ -47	0.61235	≤ 20	PASS
		2480	30~1000	907.85	-80.60	≤ -54	0.00871	≤ 4	PASS
			1000~12500	3677.78	-62.98	≤ -47	0.50350	≤ 20	PASS
	3DH5	2402	30~1000	843.83	-81.09	≤ -54	0.00778	≤ 4	PASS
			1000~12500	4087.75	-62.53	≤ -47	0.55847	≤ 20	PASS
		2441	30~1000	894.27	-80.26	≤ -54	0.00942	≤ 4	PASS
			1000~12500	3655.35	-62.05	≤ -47	0.62373	≤ 20	PASS
		2480	30~1000	822.49	-80.23	≤ -54	0.00948	≤ 4	PASS
			1000~12500	4782.35	-63.12	≤ -47	0.48753	≤ 20	PASS

Note: Both left and right earphone have tested, The right earphone is the worst, only the worse case was reported.




Test Graphs 1


NTNV_DH5_Ant1_2402_30~1000

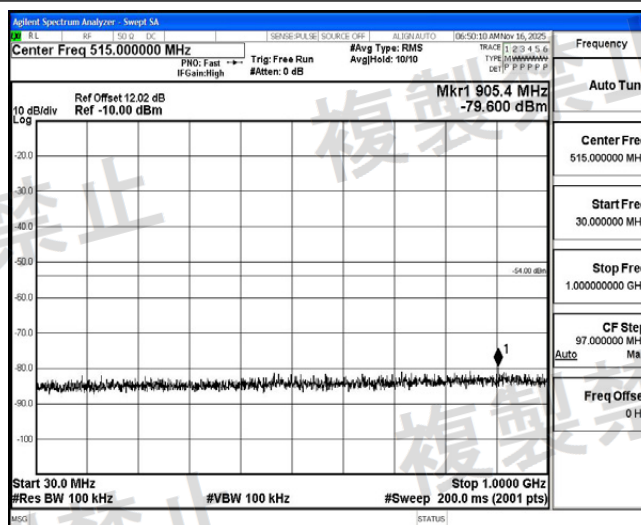

NTNV_DH5_Ant1_2402_1000~12500

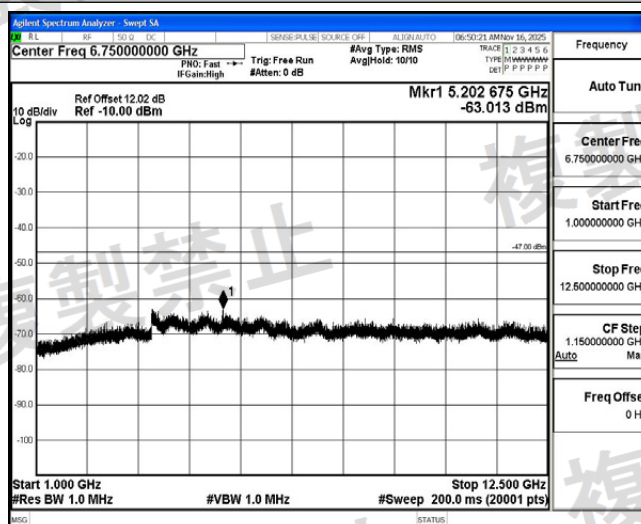


NTNV_DH5_Ant1_2441_30~1000

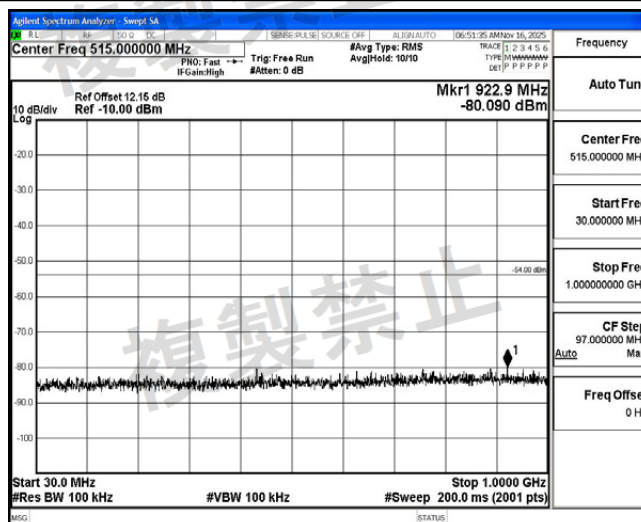


Dongguan DN Testing Co., Ltd.




NTNV_DH5_Ant1_2441_1000~12500

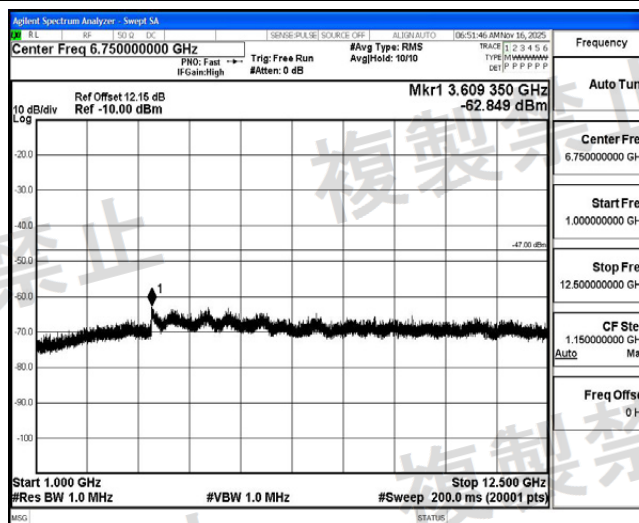

NTNV_DH5_Ant1_2480_30~1000

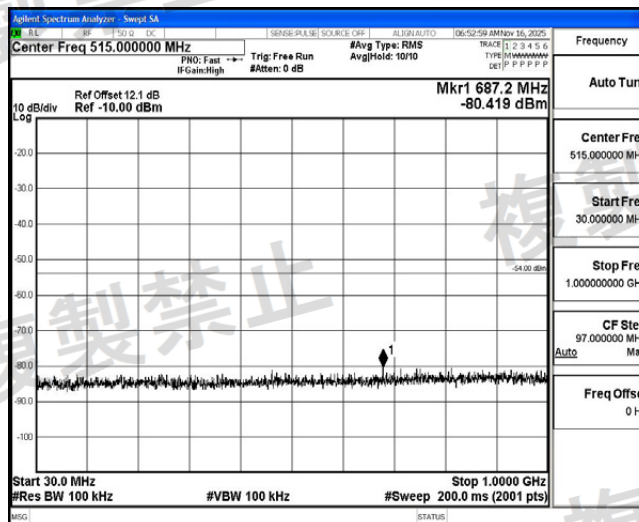


NTNV_DH5_Ant1_2480_1000~12500

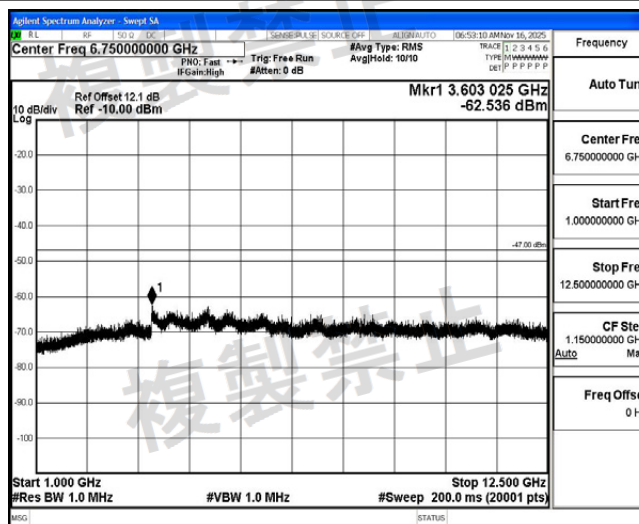


NTNV_2DH5_Ant1_2402_30~1000


Dongguan DN Testing Co., Ltd.

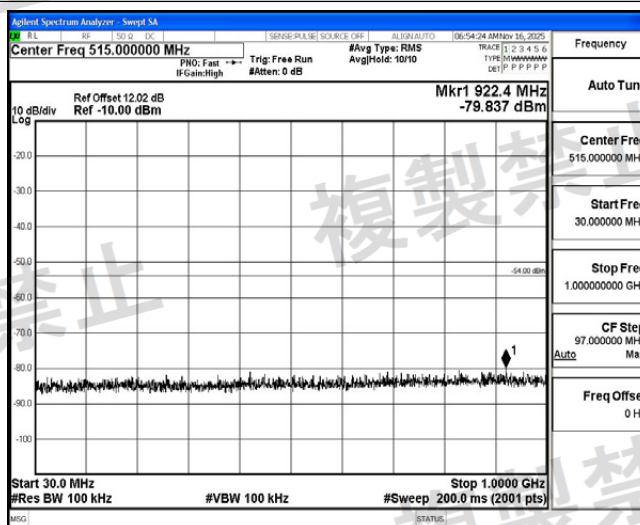


NTNV_2DH5_Ant1_2402_1000~12500

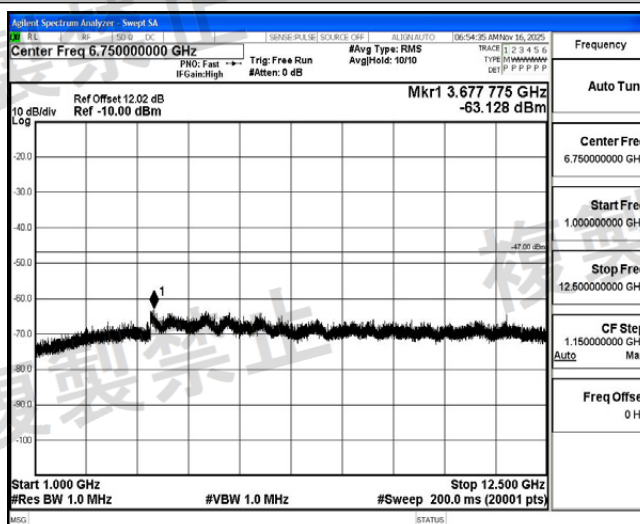


NTNV_2DH5_Ant1_2441_30~1000

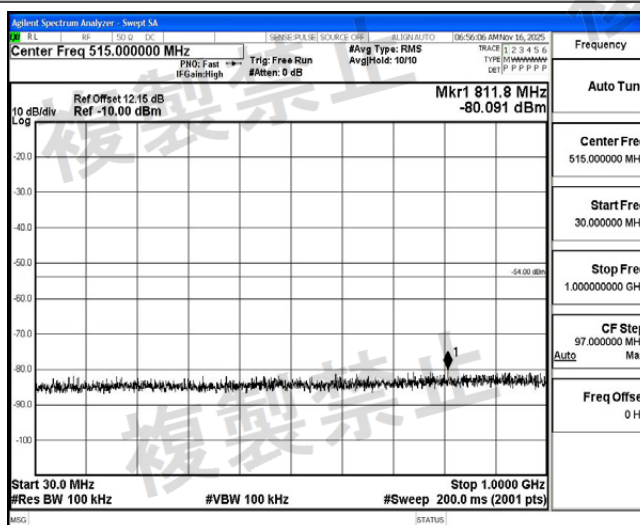


NTNV_2DH5_Ant1_2441_1000~12500

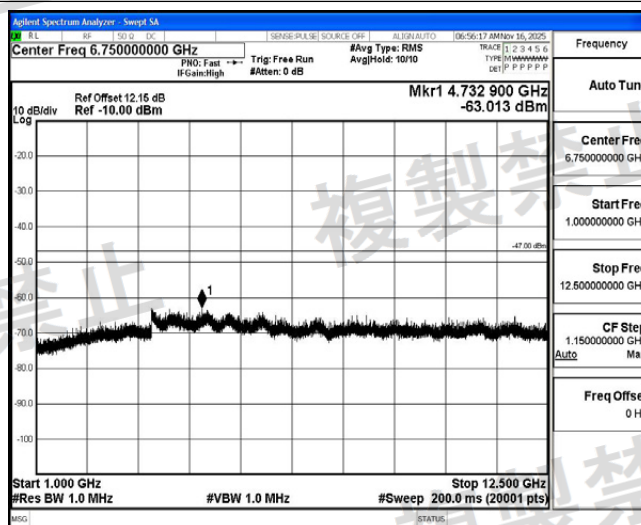


NTNV_2DH5_Ant1_2480_30~1000

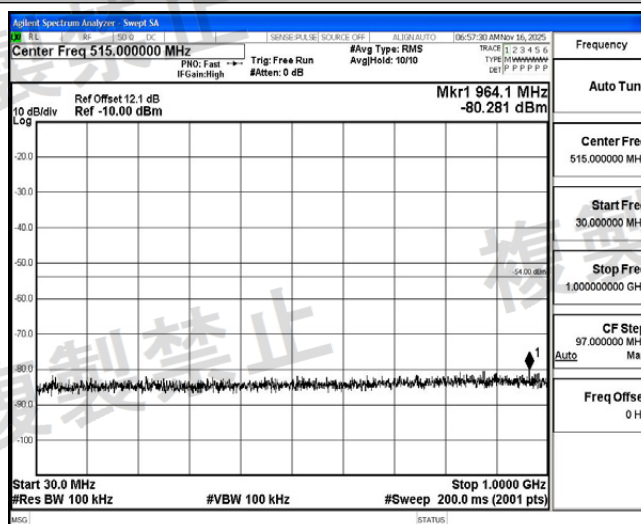


NTNV_2DH5_Ant1_2480_1000~12500

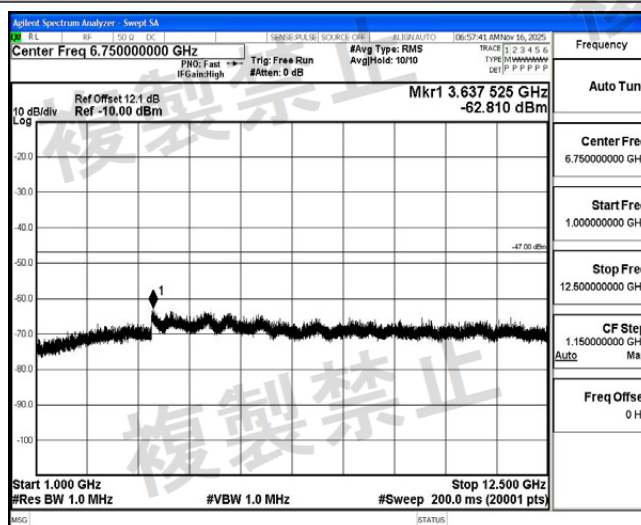


NTNV_3DH5_Ant1_2402_30~1000

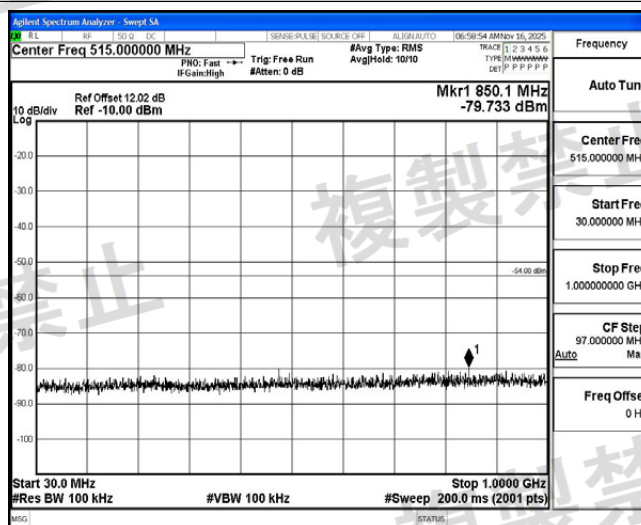


NTNV_3DH5_Ant1_2402_1000~12500

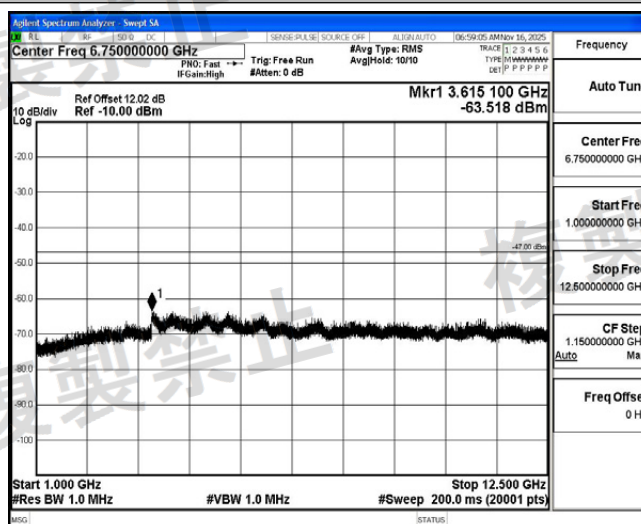


NTNV_3DH5_Ant1_2441_30~1000

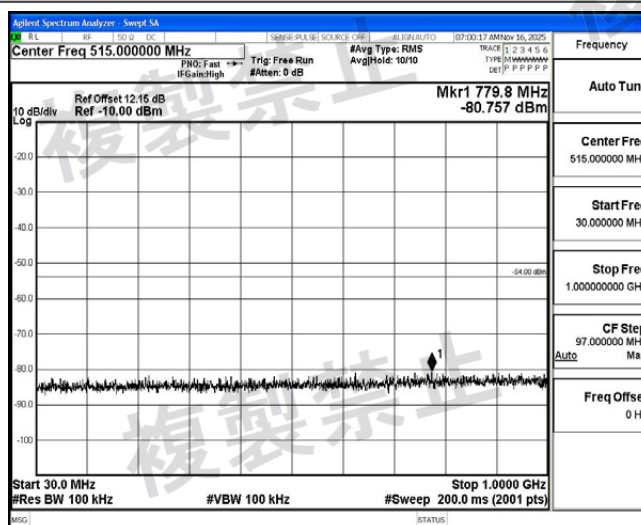


NTNV_3DH5_Ant1_2441_1000~12500

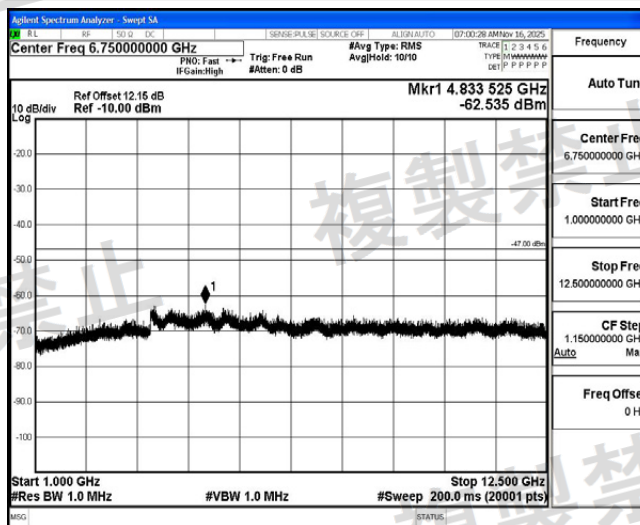


NTNV_3DH5_Ant1_2480_30~1000

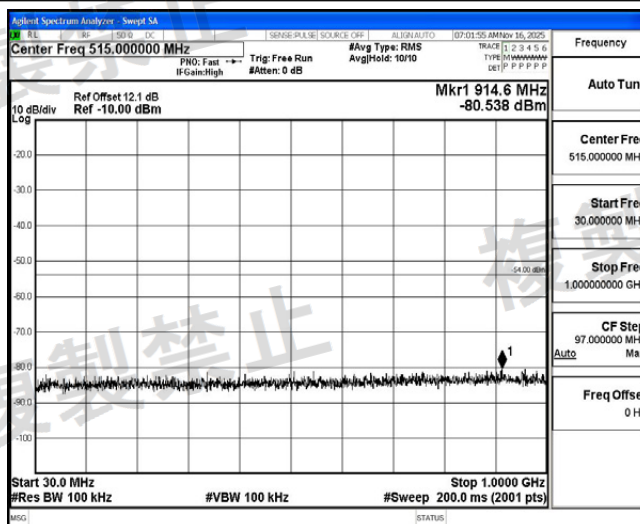


NTNV_3DH5_Ant1_2480_1000~12500

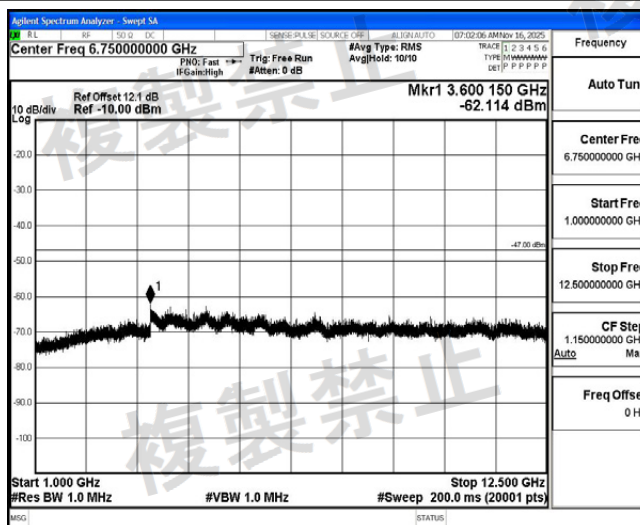


NTLV_DH5_Ant1_2402_30~1000

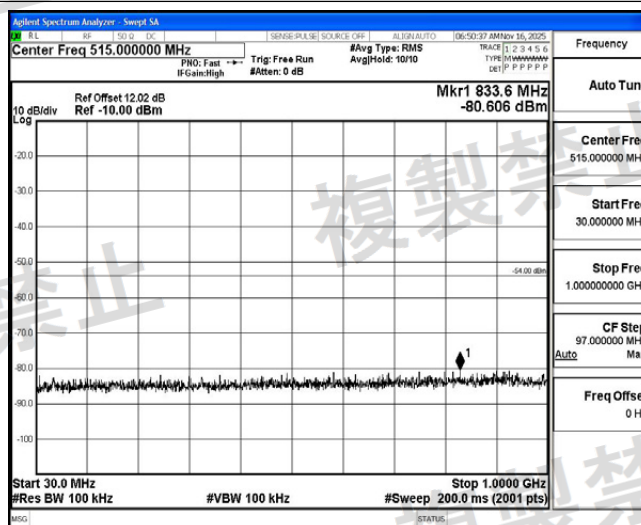


NTLV_DH5_Ant1_2402_1000~12500

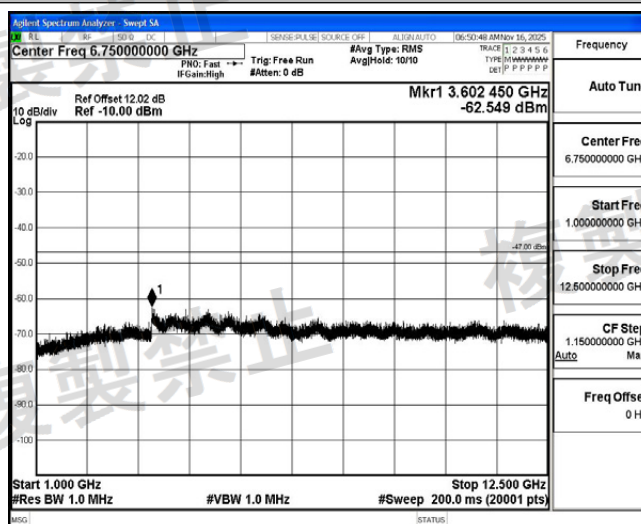


NTLV_DH5_Ant1_2441_30~1000

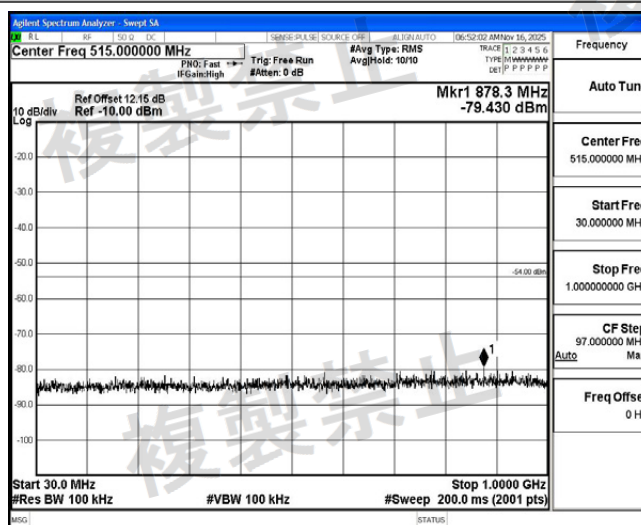


NTLV_DH5_Ant1_2441_1000~12500

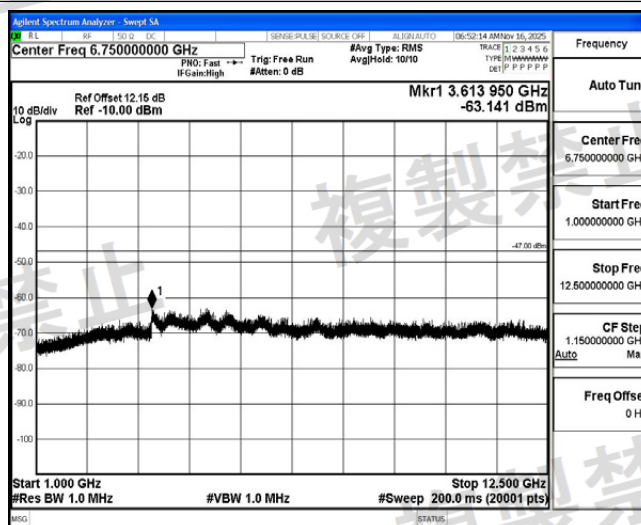


NTLV_DH5_Ant1_2480_30~1000

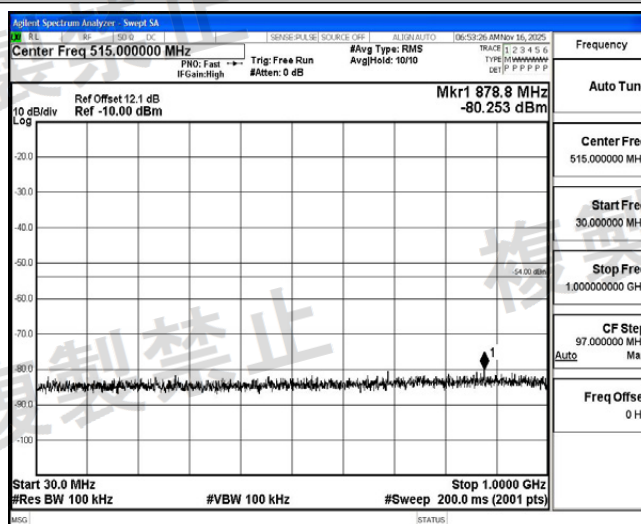


NTLV_DH5_Ant1_2480_1000~12500

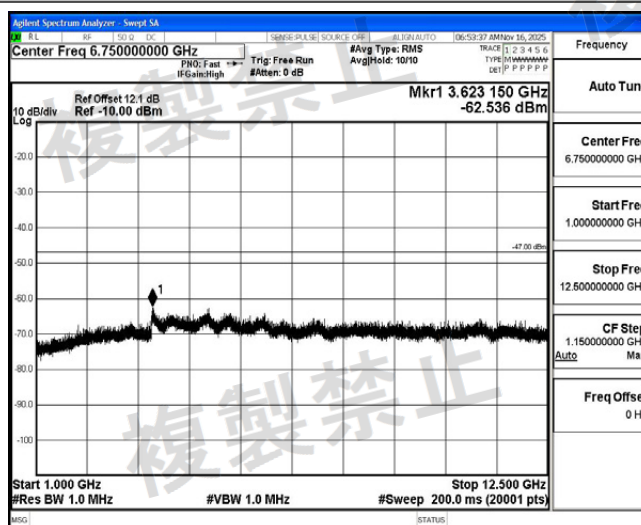


NTLV_2DH5_Ant1_2402_30~1000

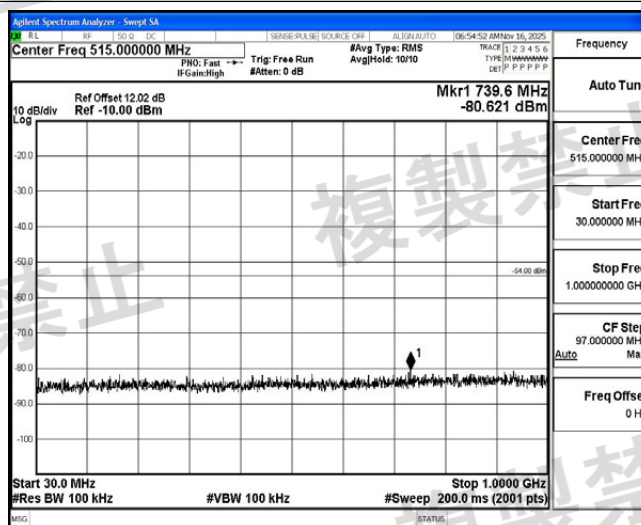

NTLV_2DH5_Ant1_2402_1000~12500

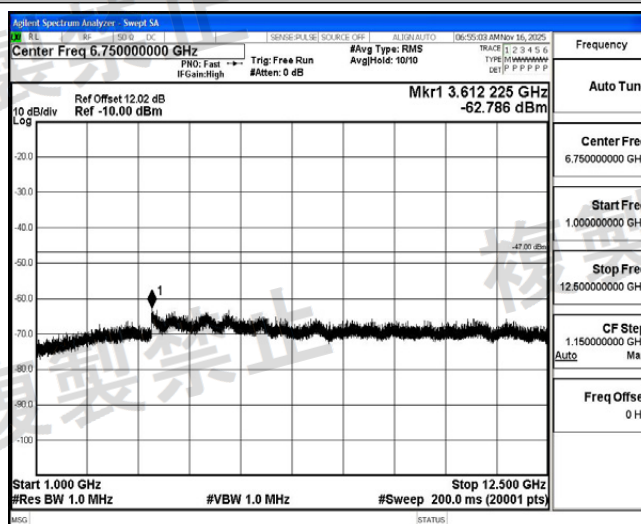


NTLV_2DH5_Ant1_2441_30~1000

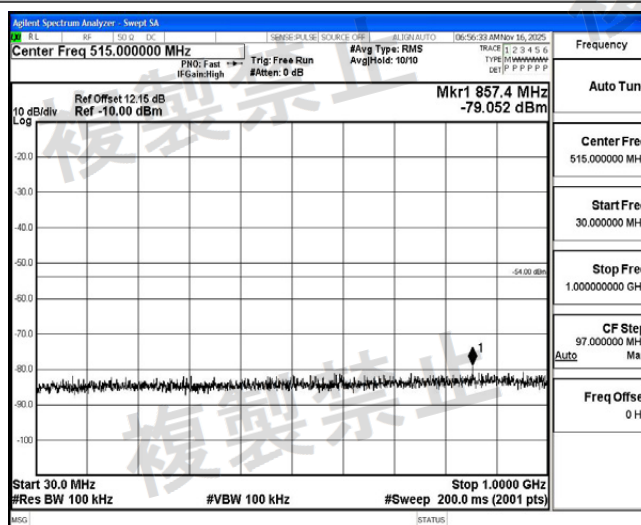


NTLV_2DH5_Ant1_2441_1000~12500


Dongguan DN Testing Co., Ltd.

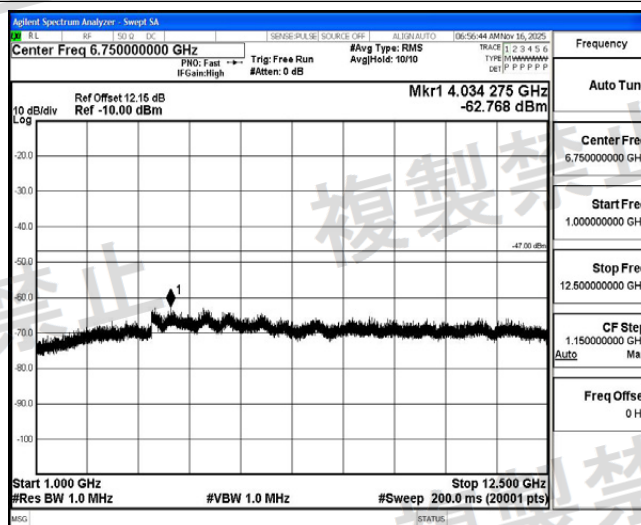


NTLV_2DH5_Ant1_2480_30~1000

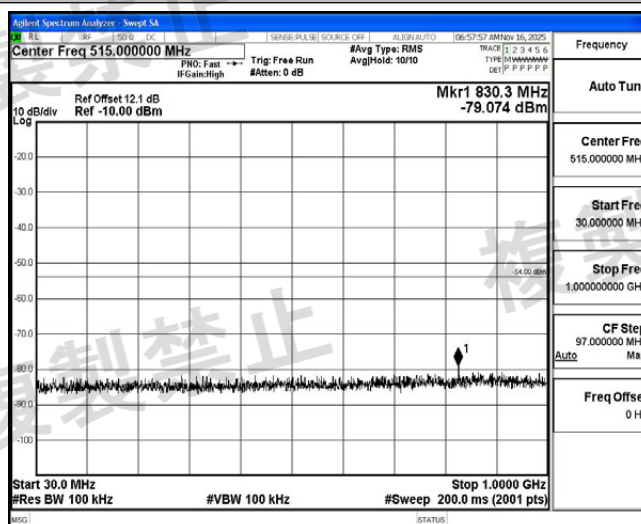


NTLV_2DH5_Ant1_2480_1000~12500

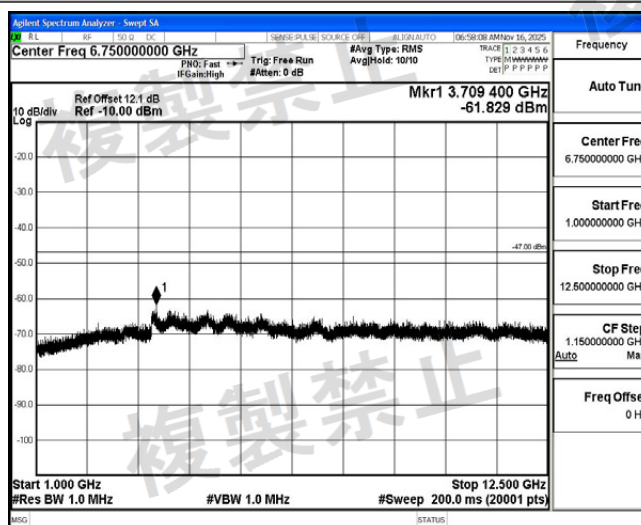


NTLV_3DH5_Ant1_2402_30~1000

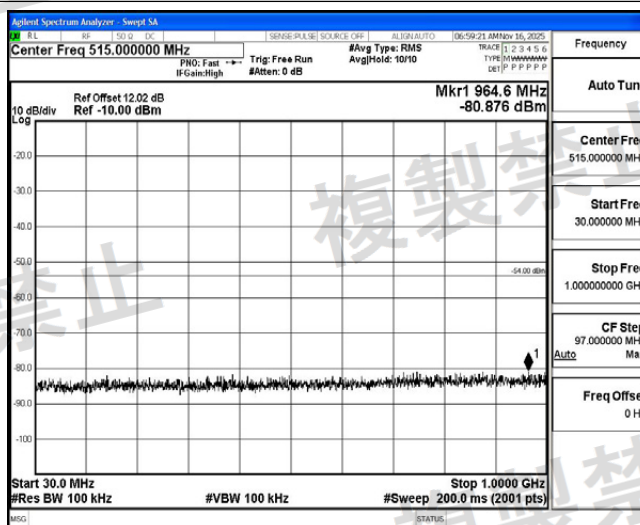


NTLV_3DH5_Ant1_2402_1000~12500

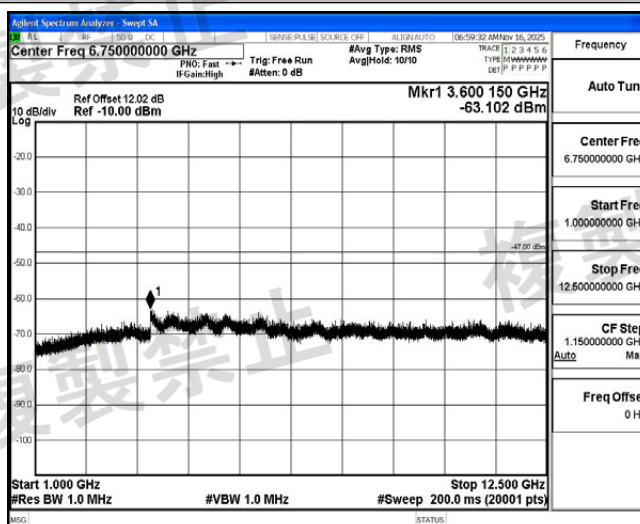


NTLV_3DH5_Ant1_2441_30~1000

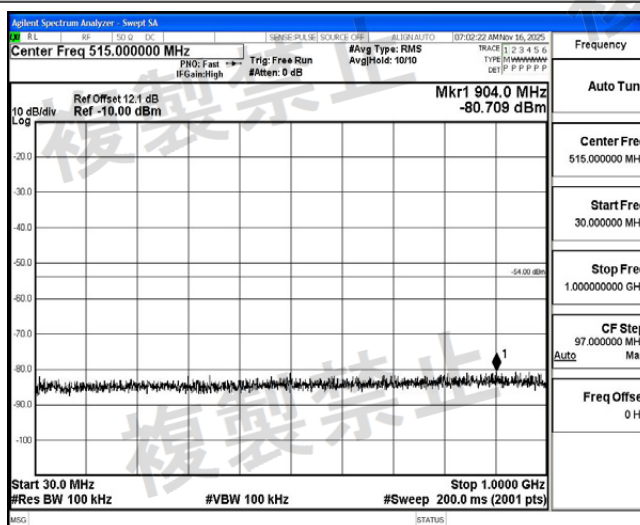


NTLV_3DH5_Ant1_2441_1000~12500

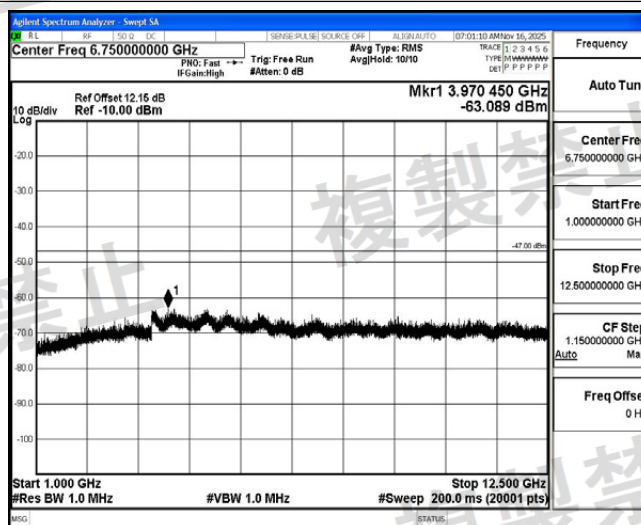


NTLV_3DH5_Ant1_2480_30~1000

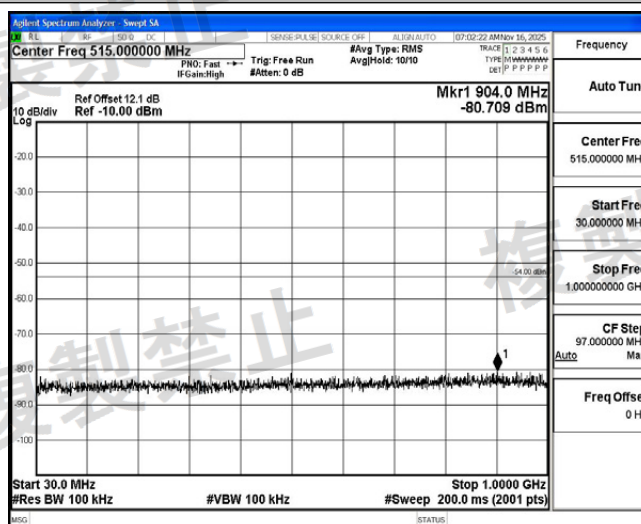


NTLV_3DH5_Ant1_2480_1000~12500

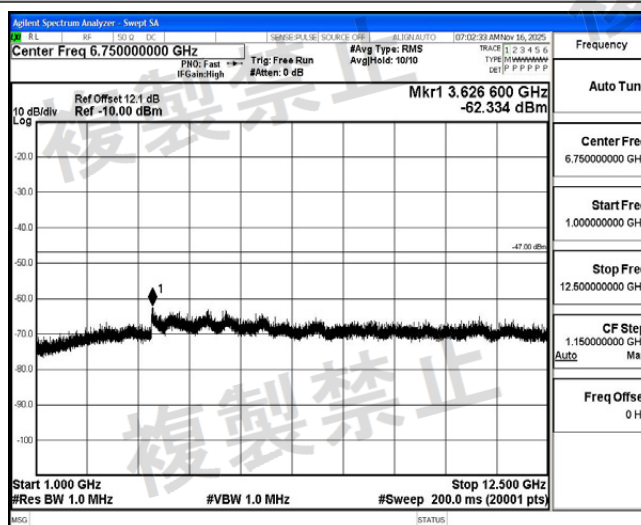


NTHV_DH5_Ant1_2402_30~1000

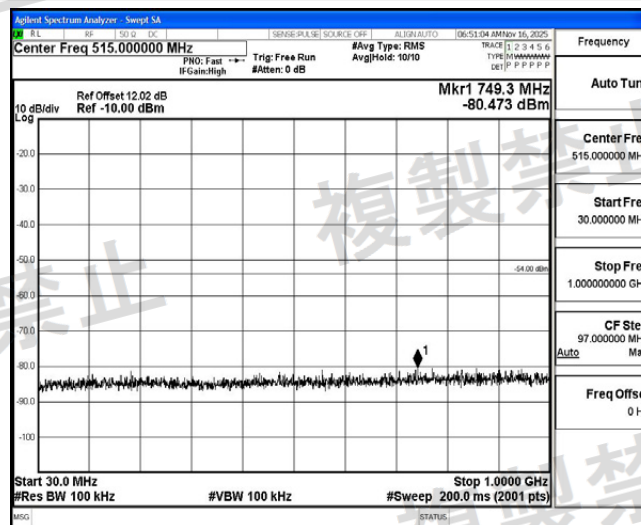


NTHV_DH5_Ant1_2402_1000~12500

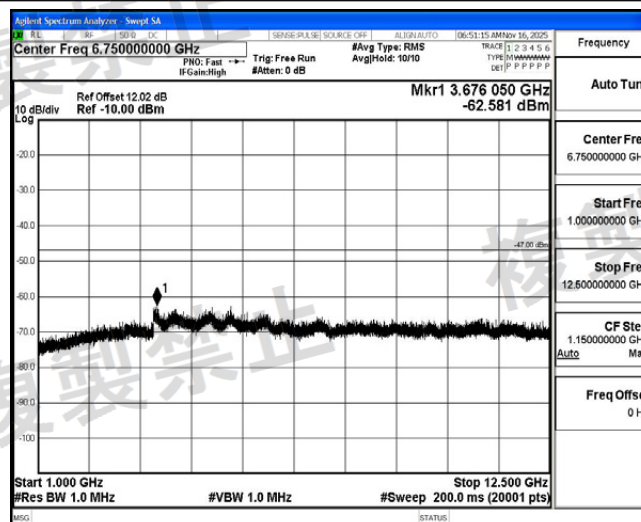


NTHV_DH5_Ant1_2441_30~1000

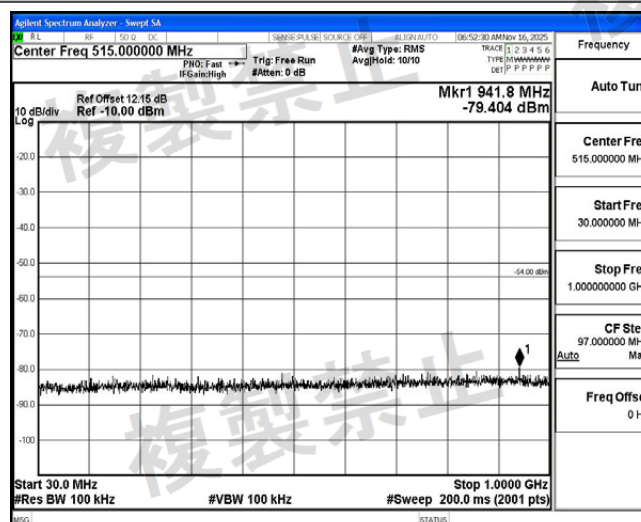


NTHV_DH5_Ant1_2441_1000~12500

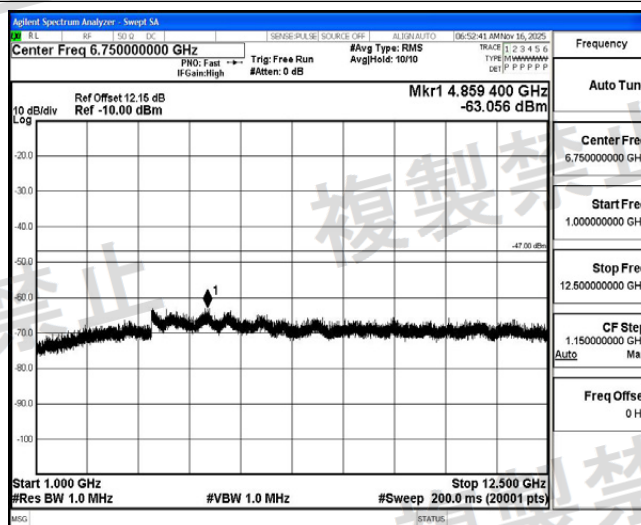


NTHV_DH5_Ant1_2480_30~1000

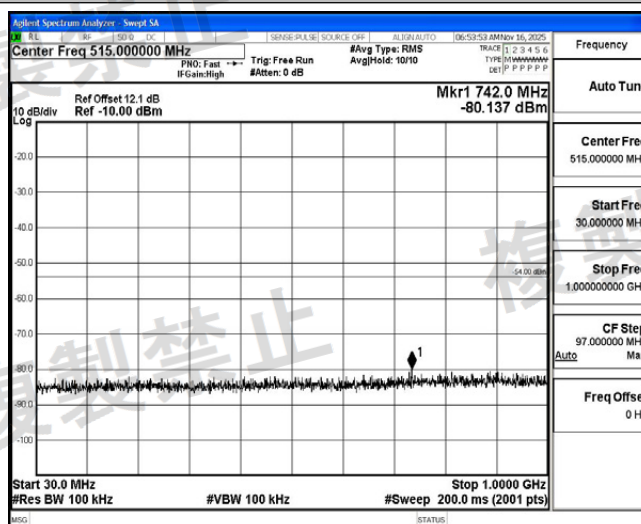


NTHV_DH5_Ant1_2480_1000~12500

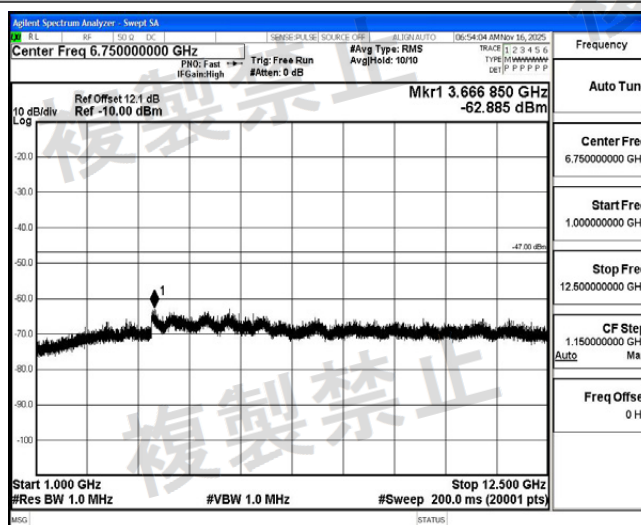


NTHV_2DH5_Ant1_2402_30~1000

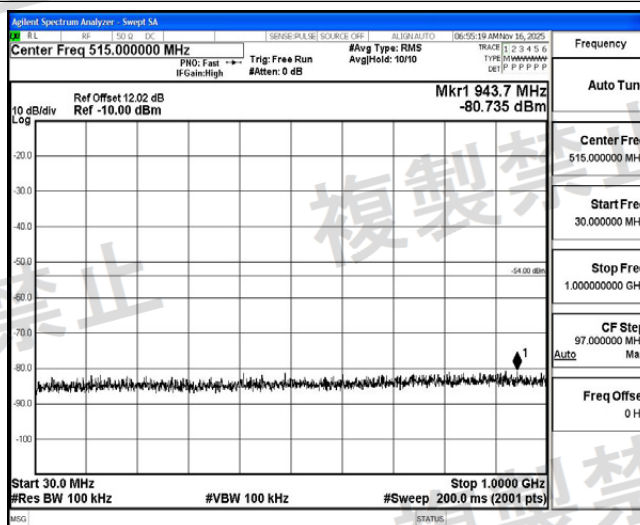


NTHV_2DH5_Ant1_2402_1000~12500

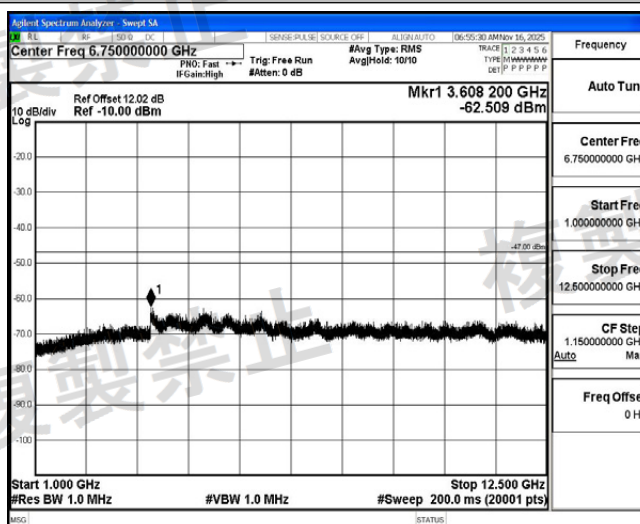


NTHV_2DH5_Ant1_2441_30~1000

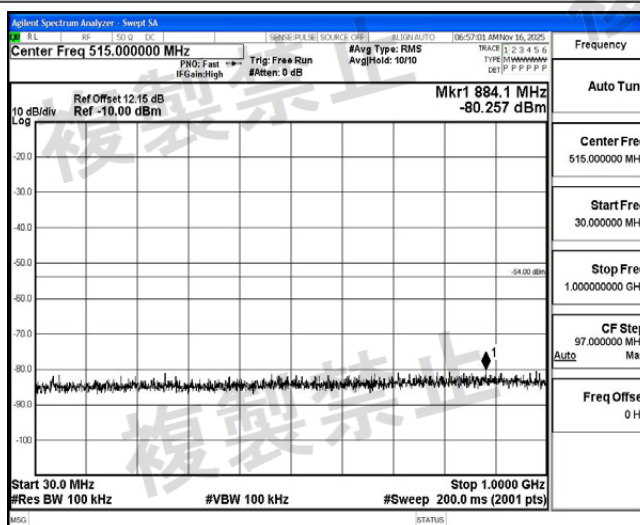


NTHV_2DH5_Ant1_2441_1000~12500

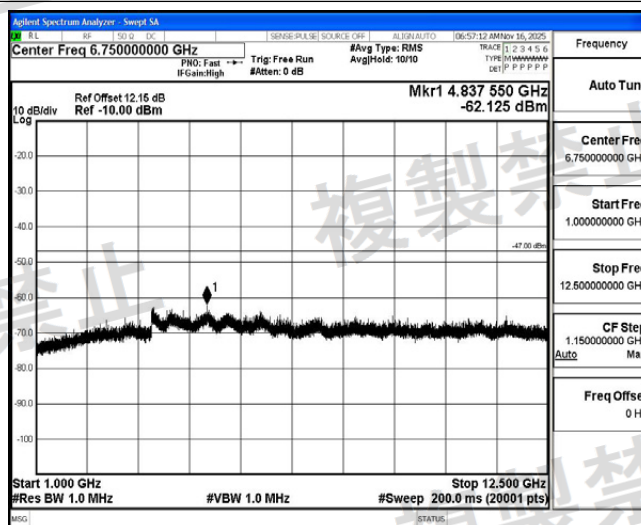


NTHV_2DH5_Ant1_2480_30~1000

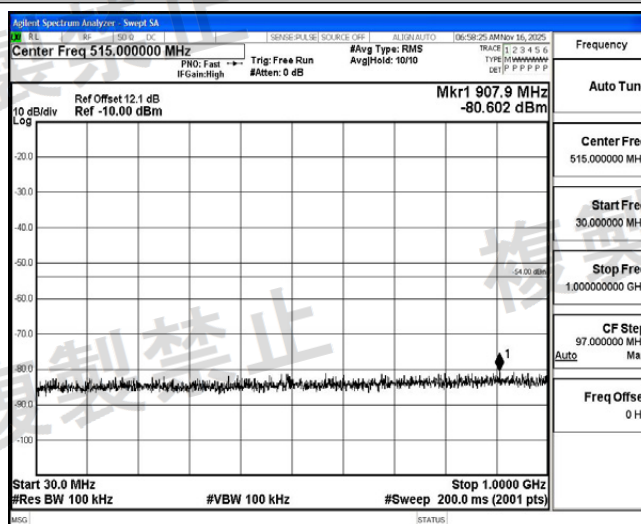


NTHV_2DH5_Ant1_2480_1000~12500

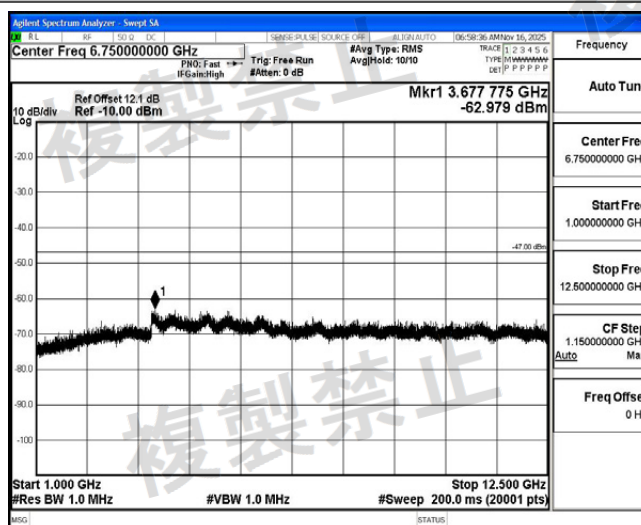


NTHV_3DH5_Ant1_2402_30~1000

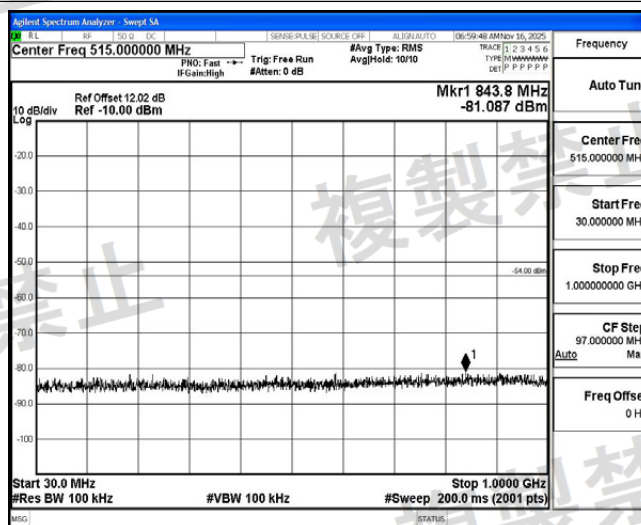


NTHV_3DH5_Ant1_2402_1000~12500

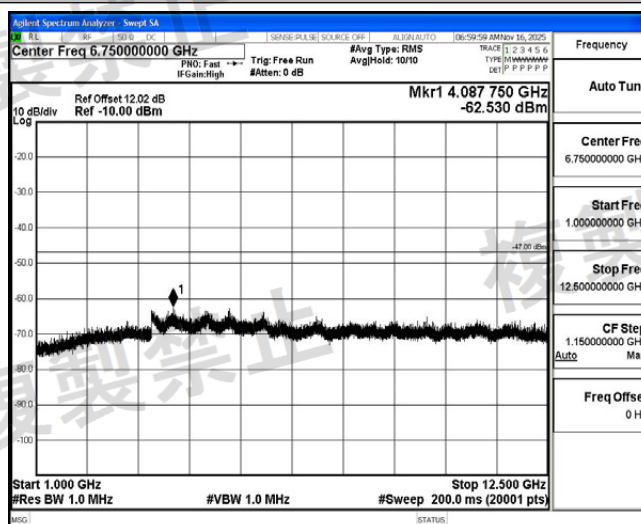


NTHV_3DH5_Ant1_2441_30~1000

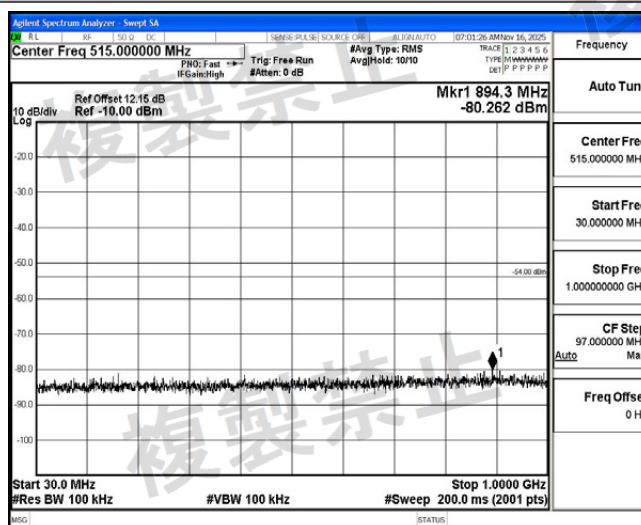


NTHV_3DH5_Ant1_2441_1000~12500

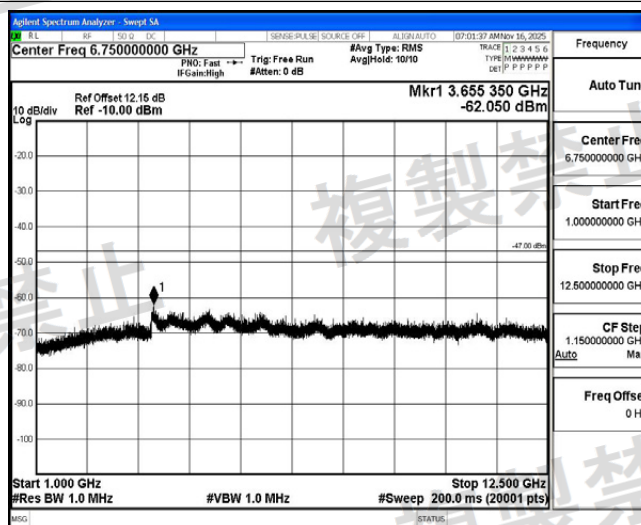

NTHV_3DH5_Ant1_2480_30~1000

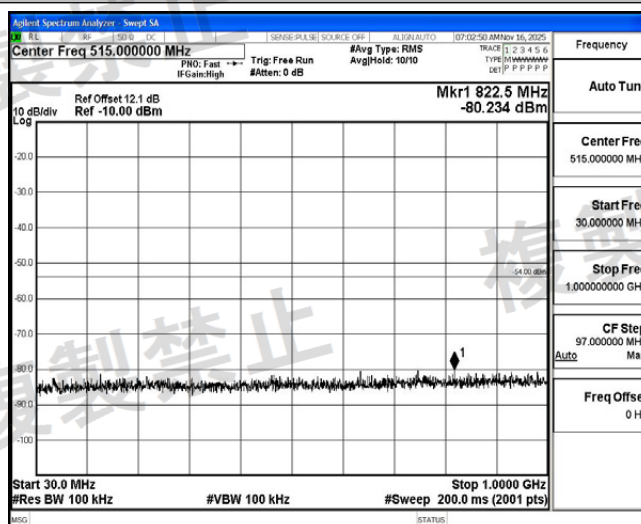

NTHV_3DH5_Ant1_2480_1000~12500

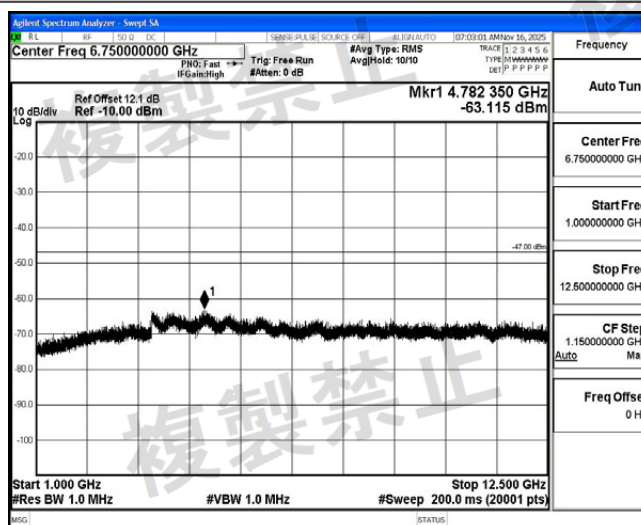

---END REPORT---

Dongguan DN Testing Co., Ltd.