






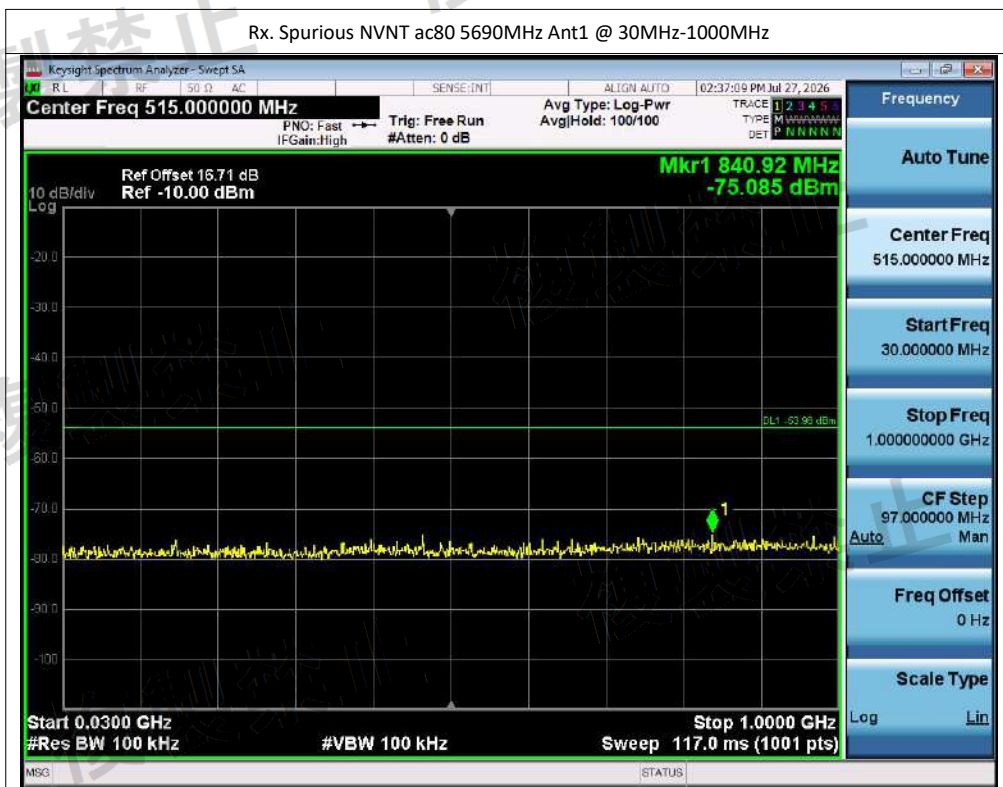


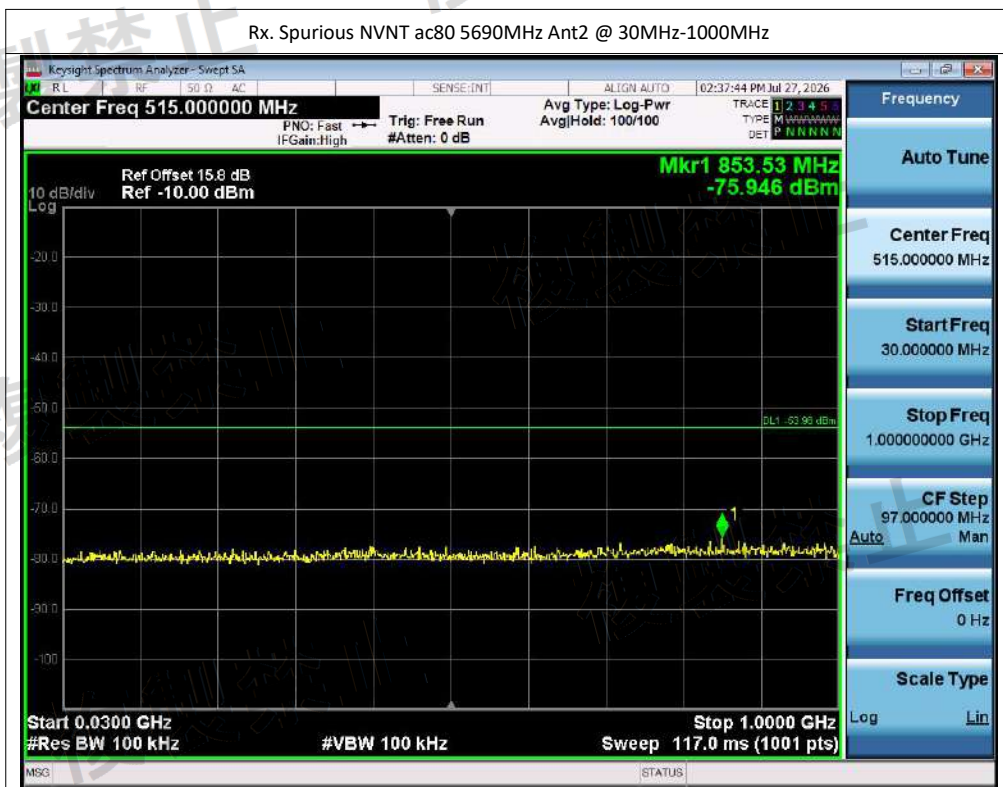


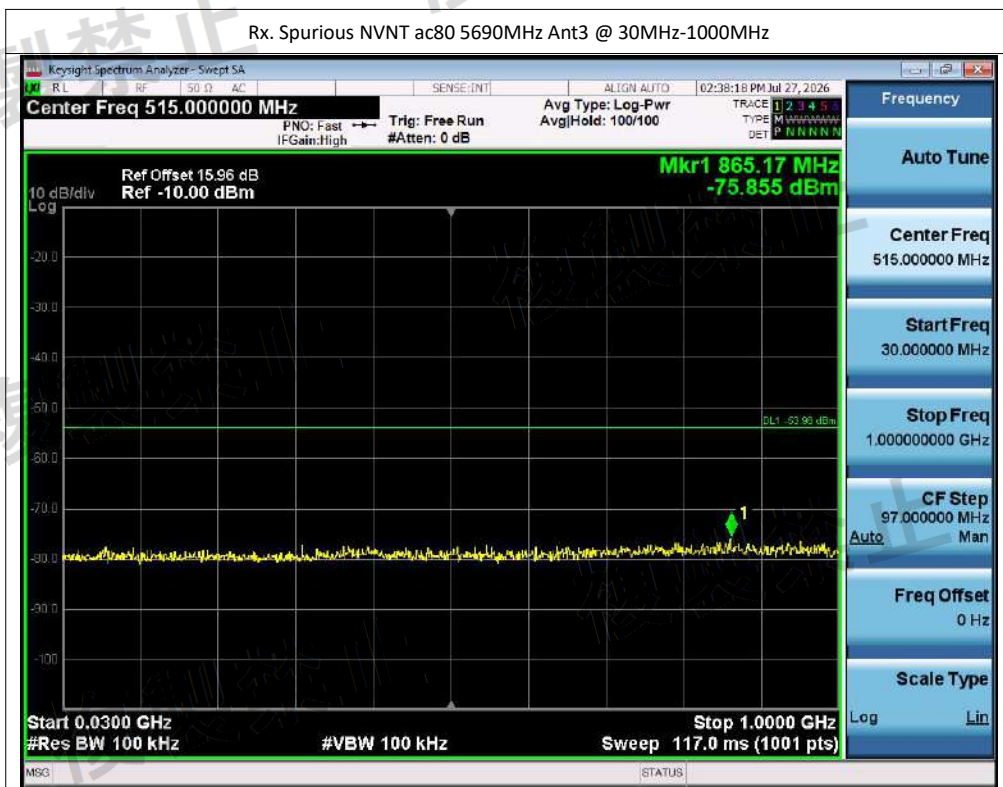


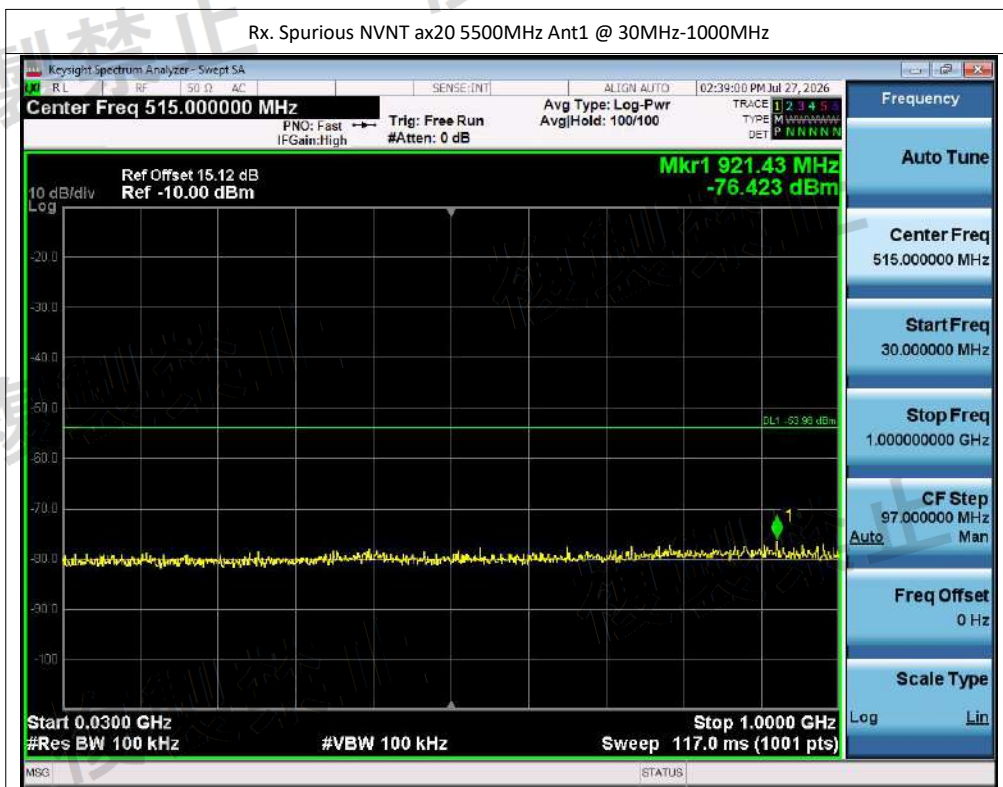


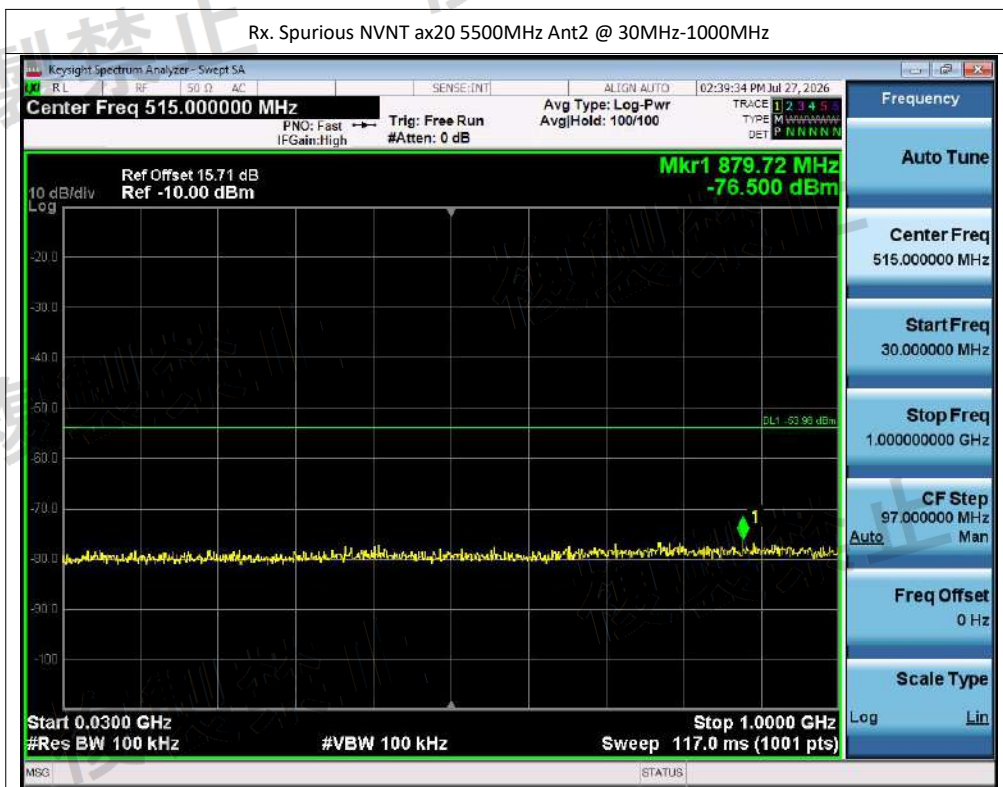


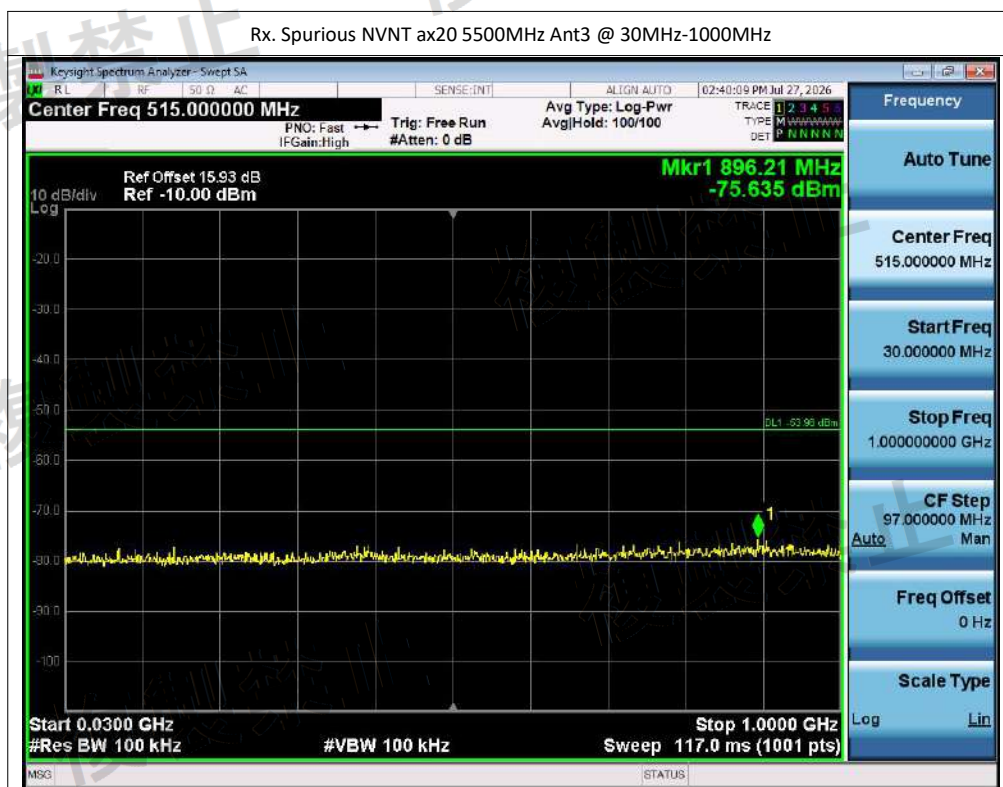


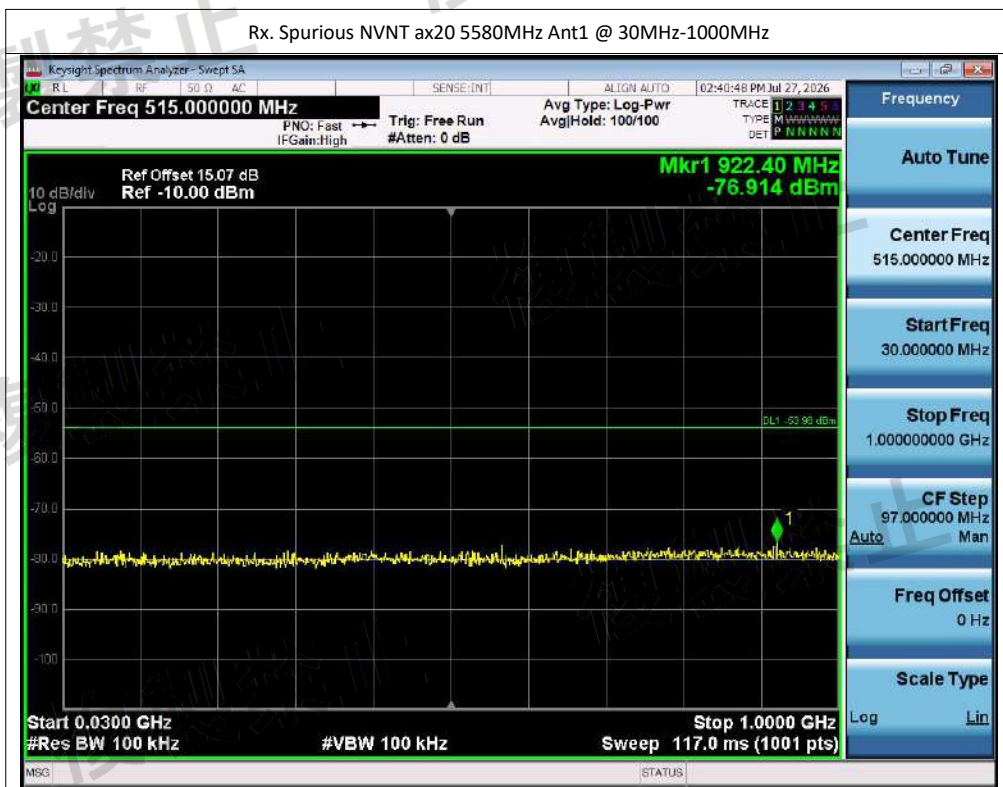


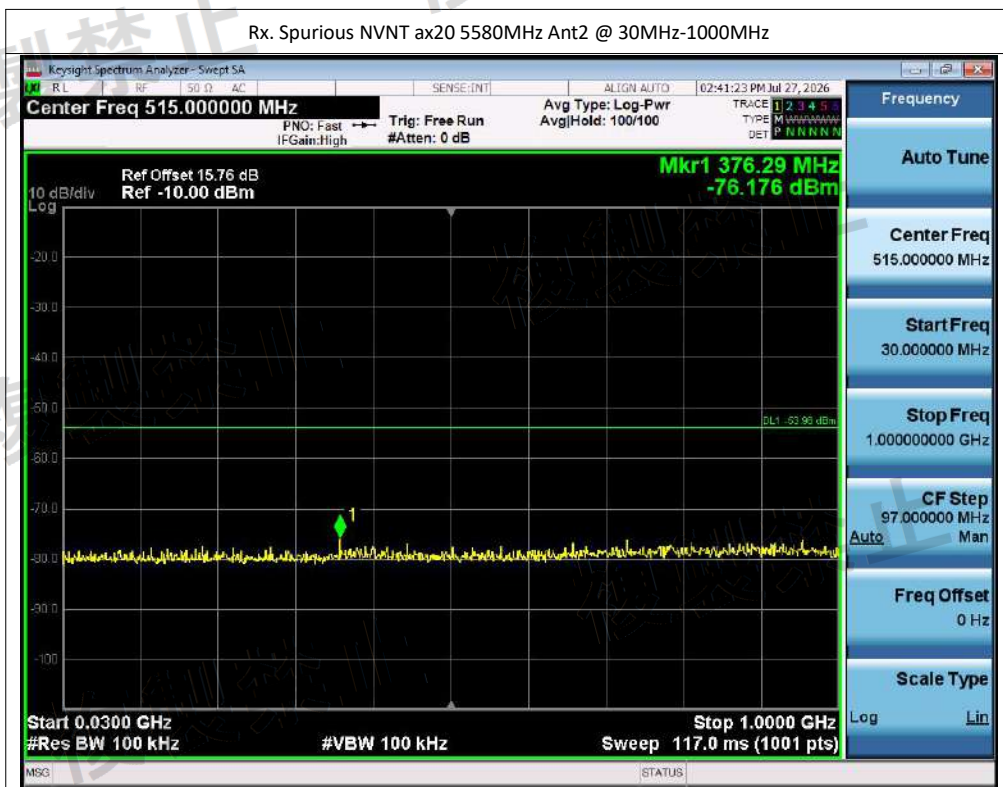


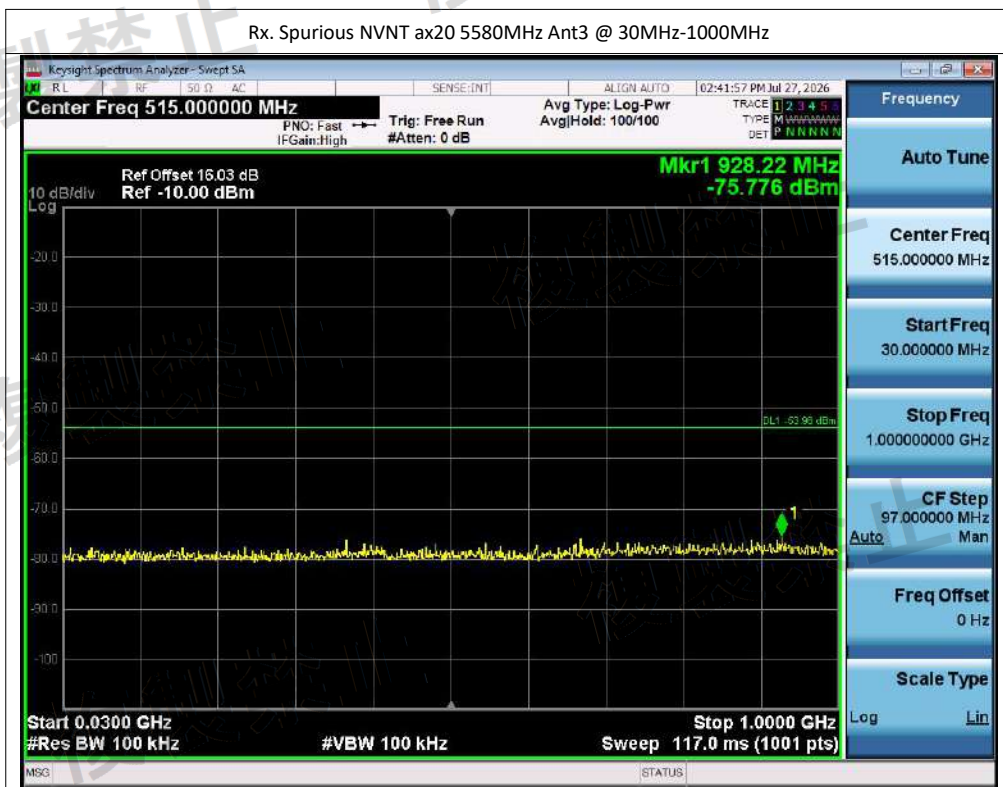


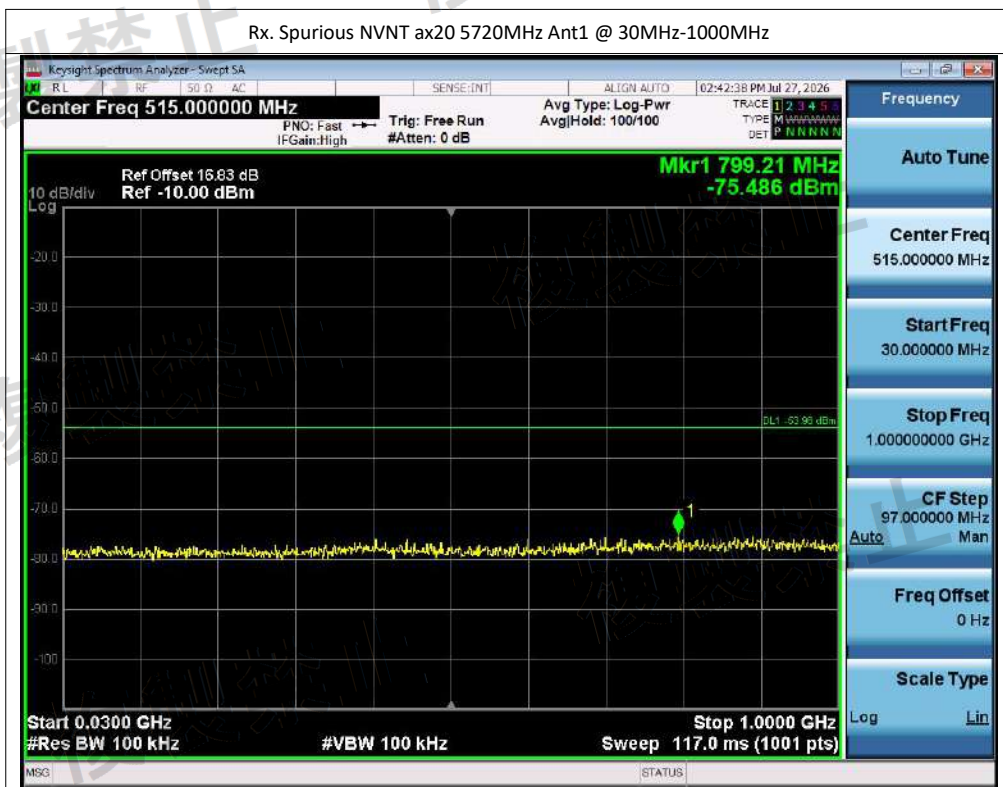


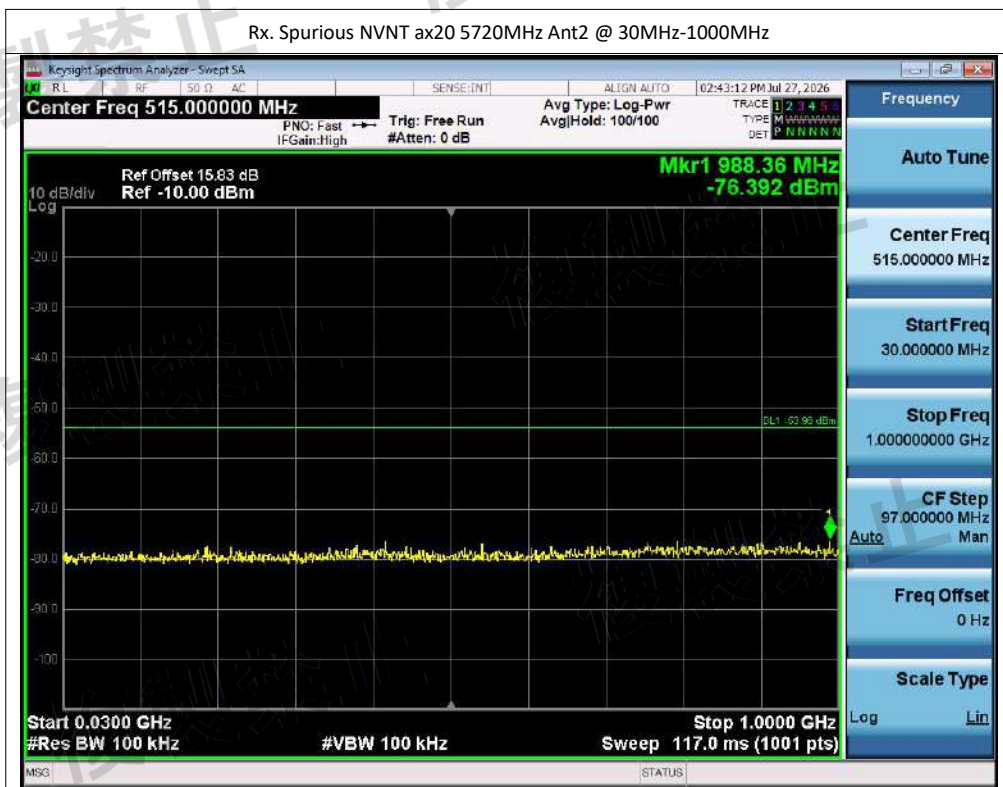


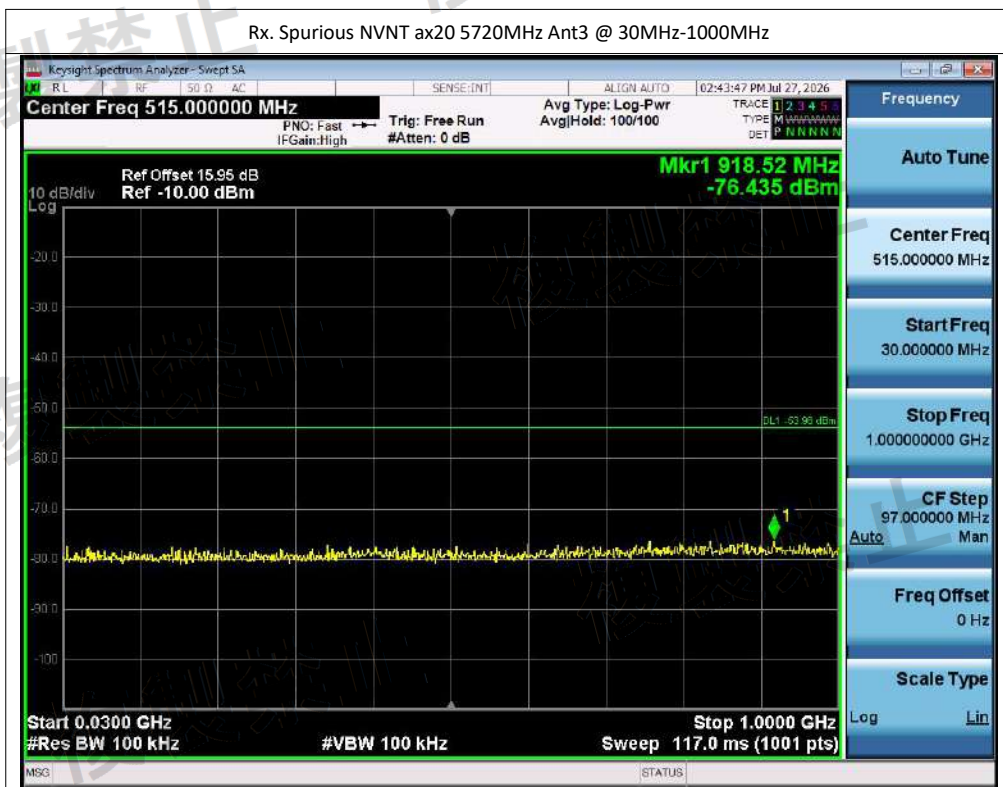


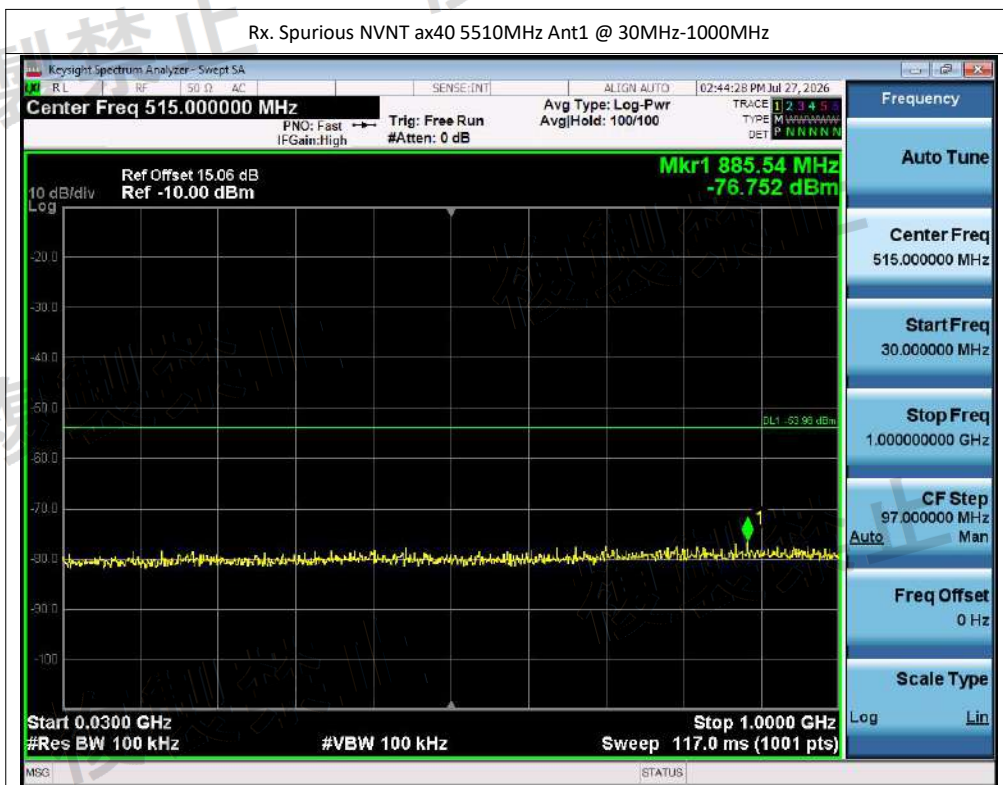


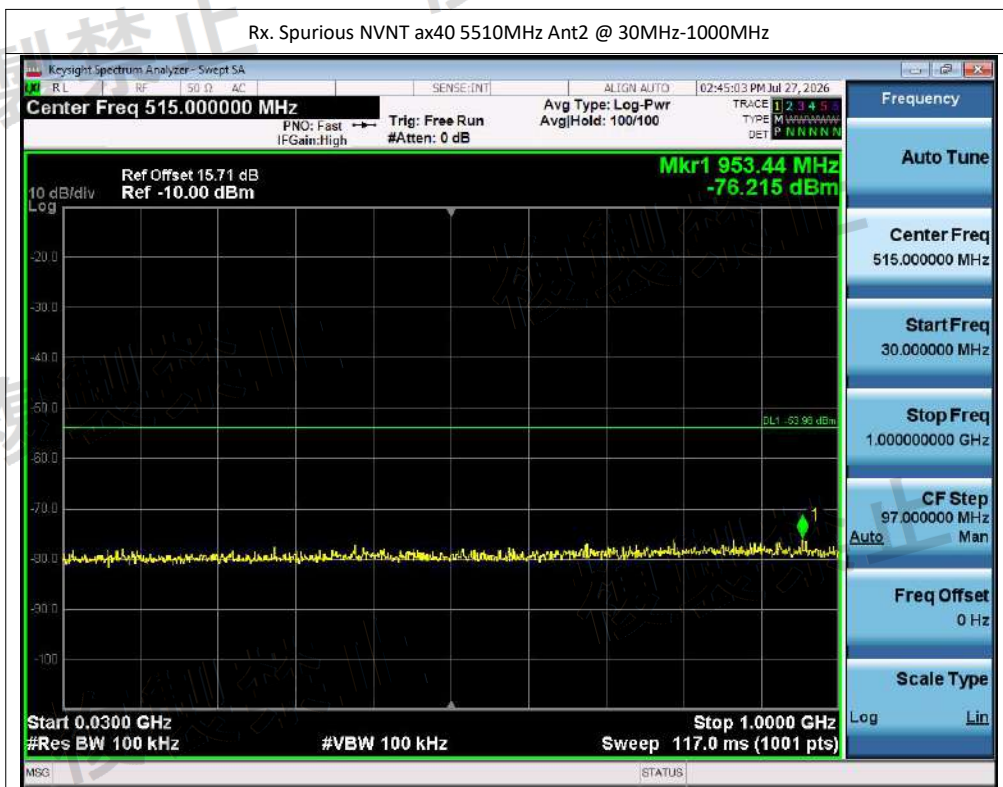


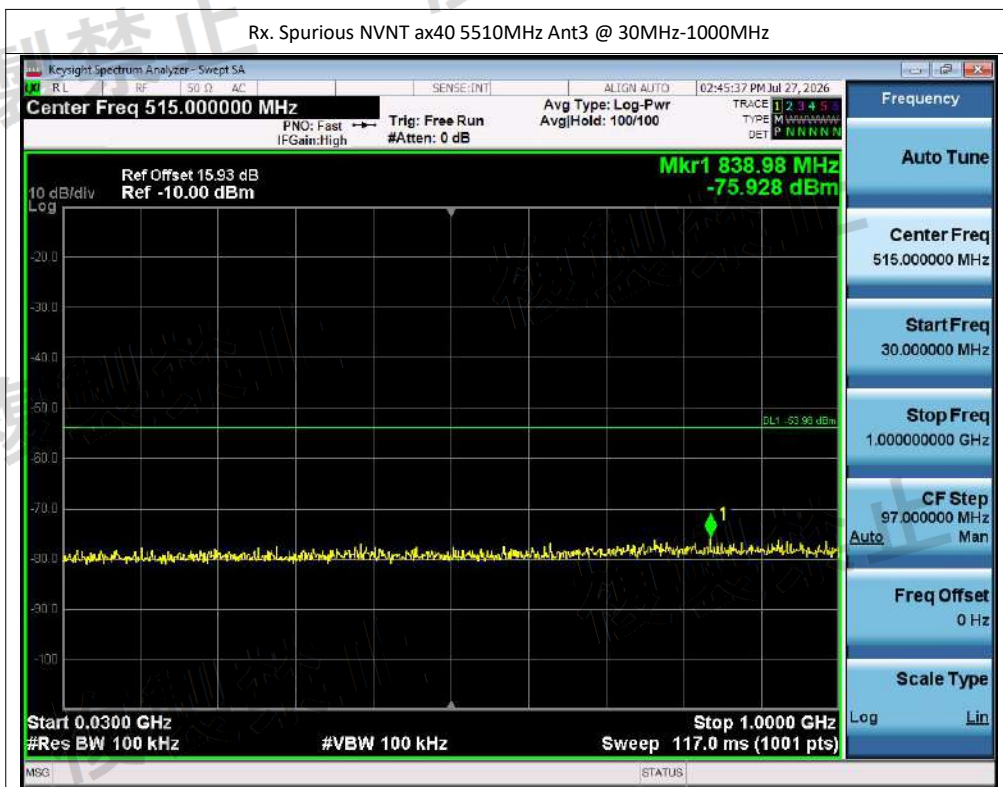


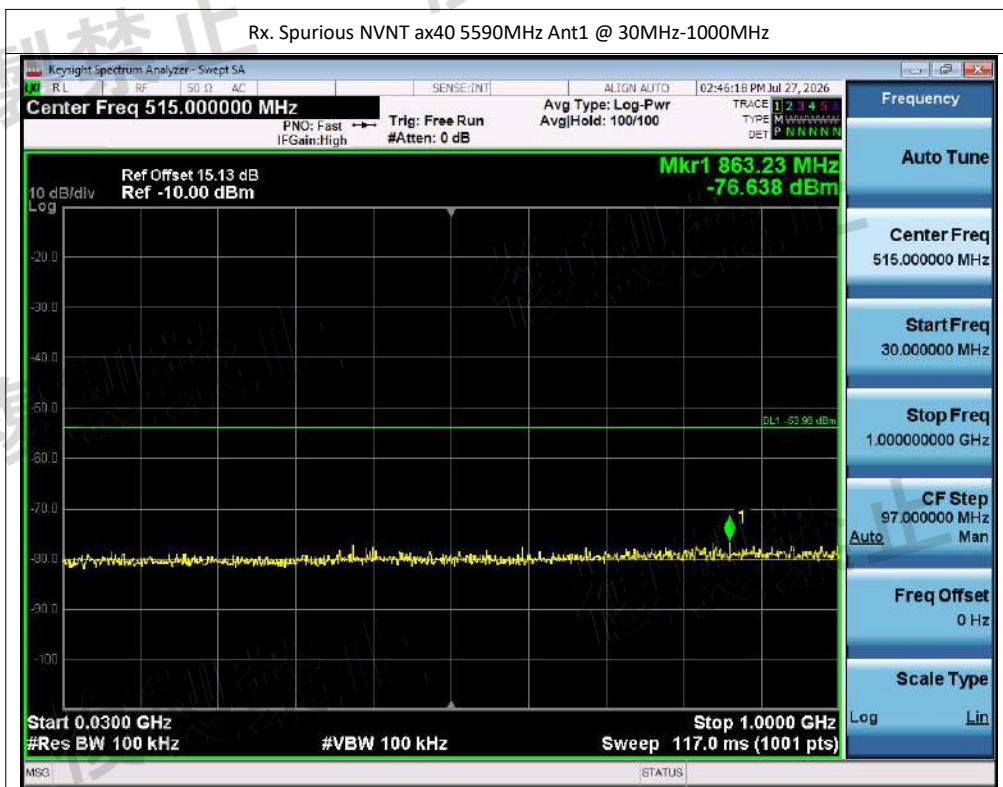


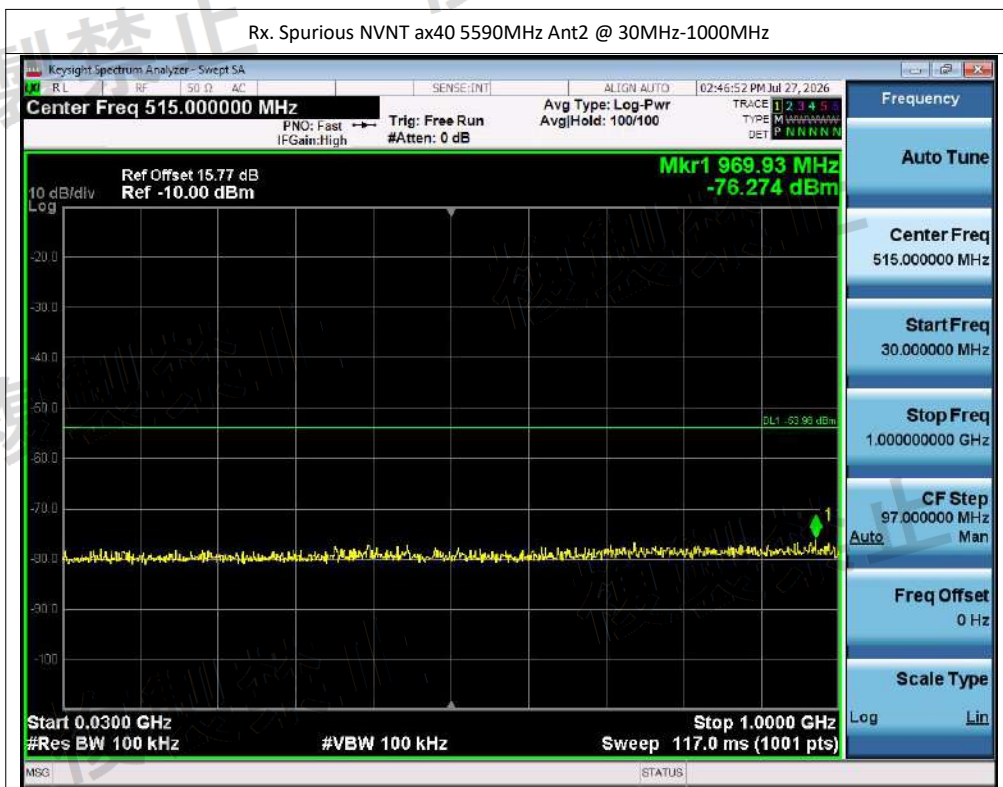


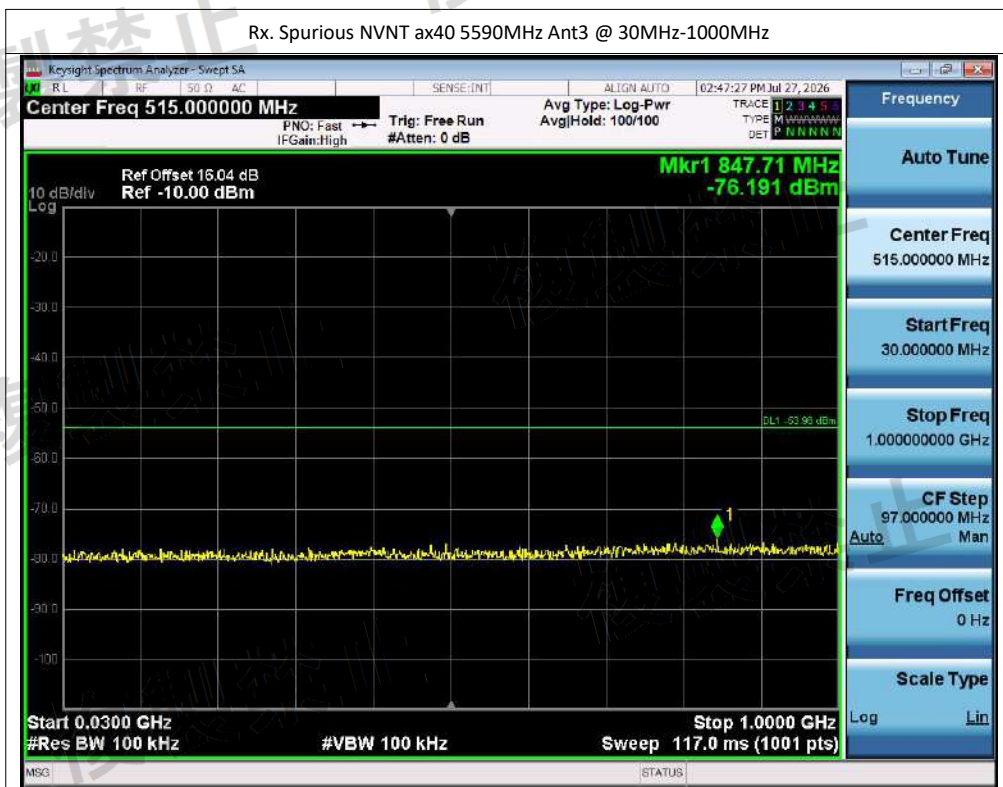


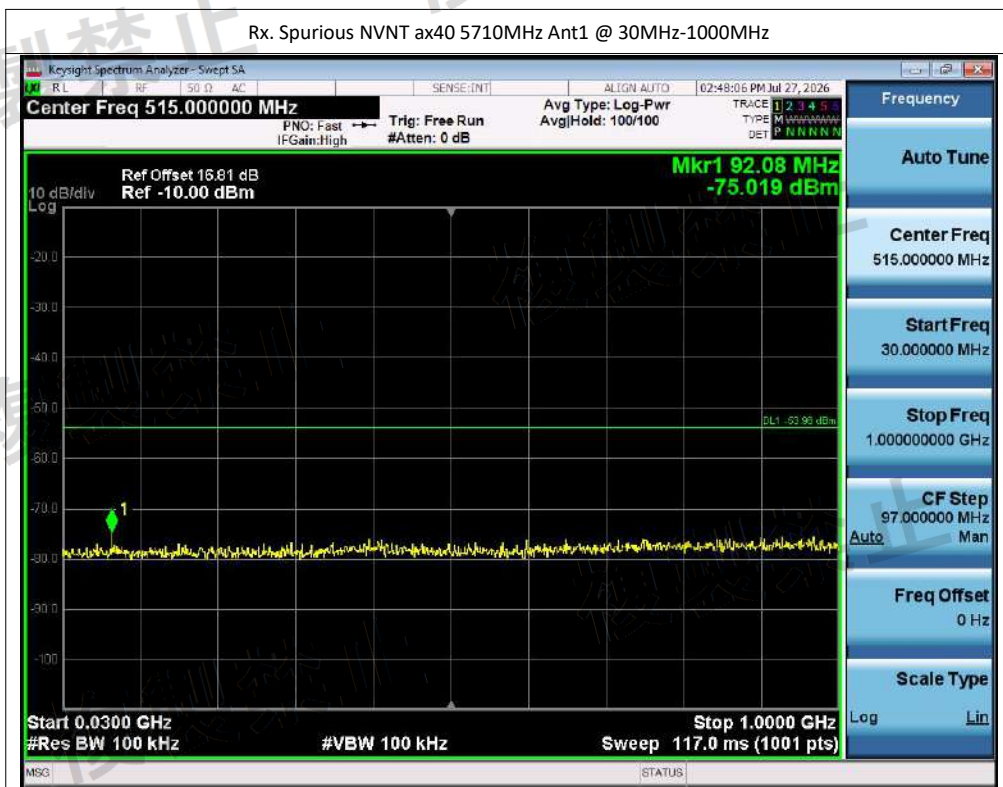


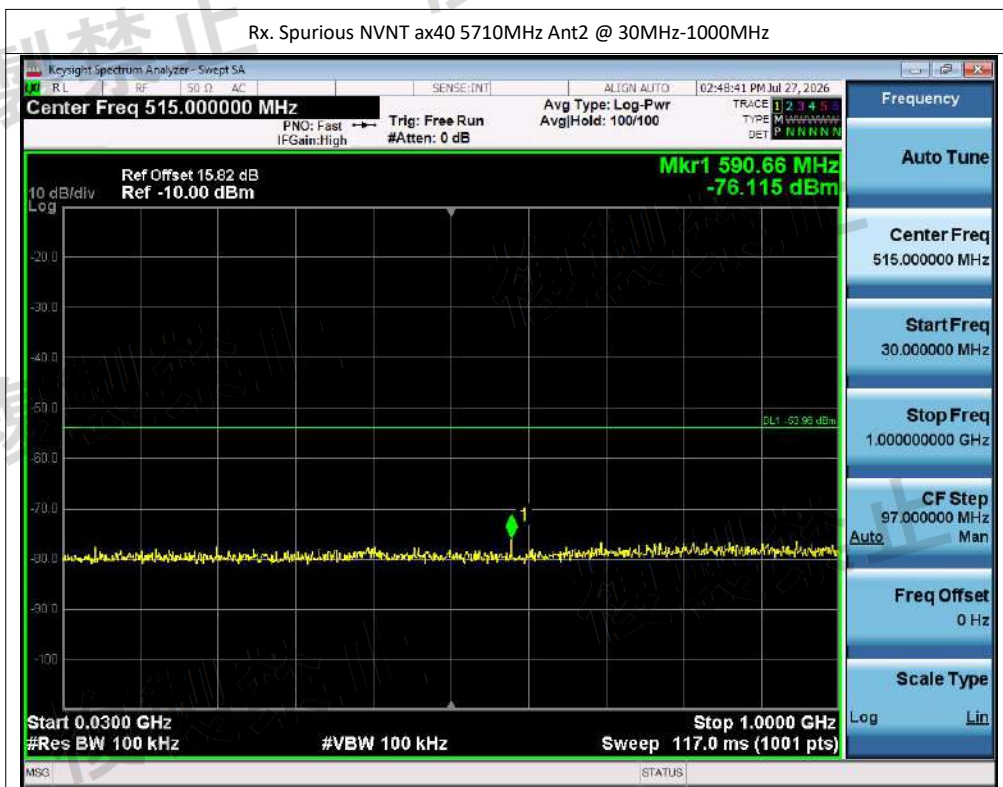


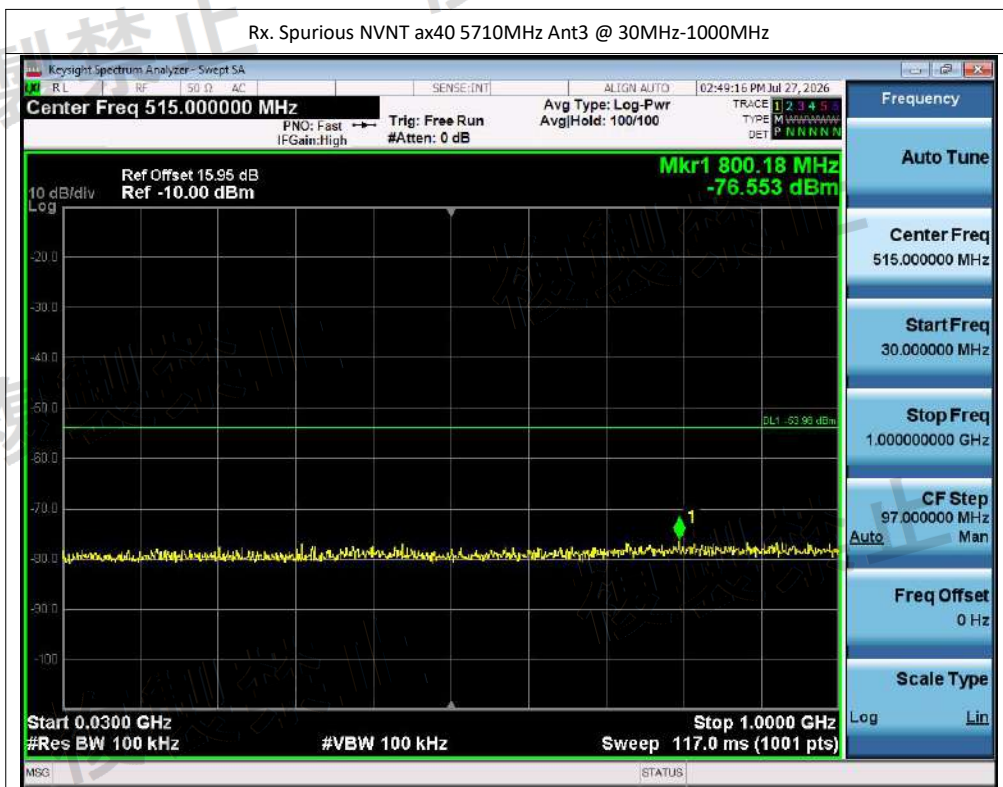


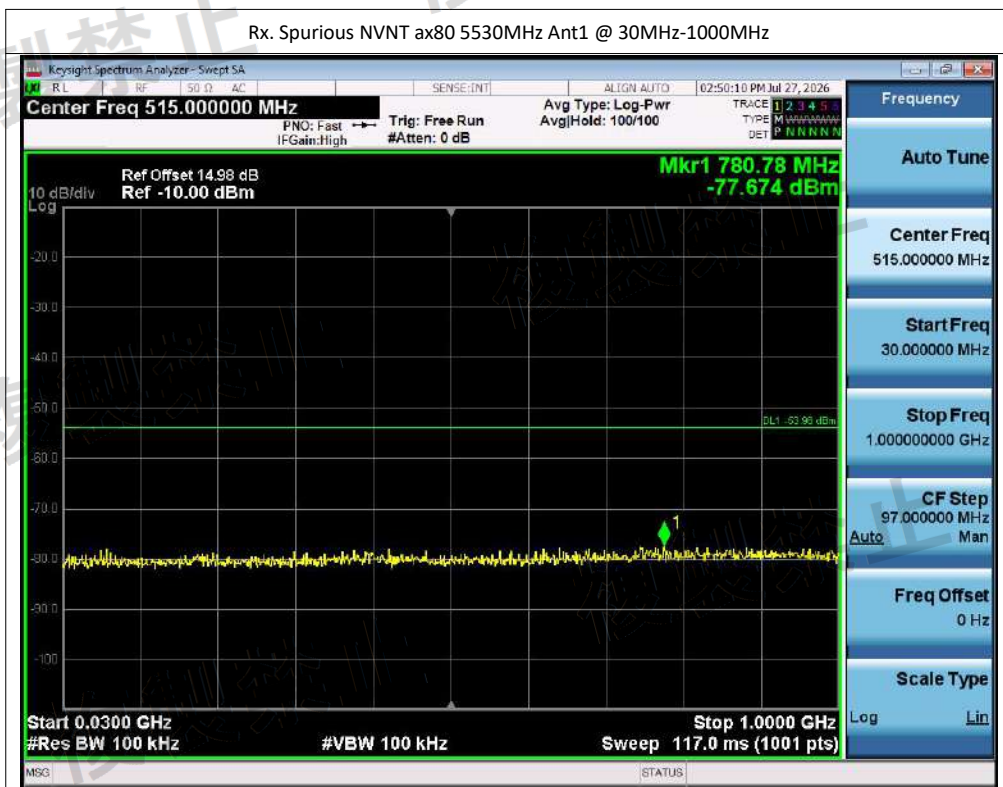


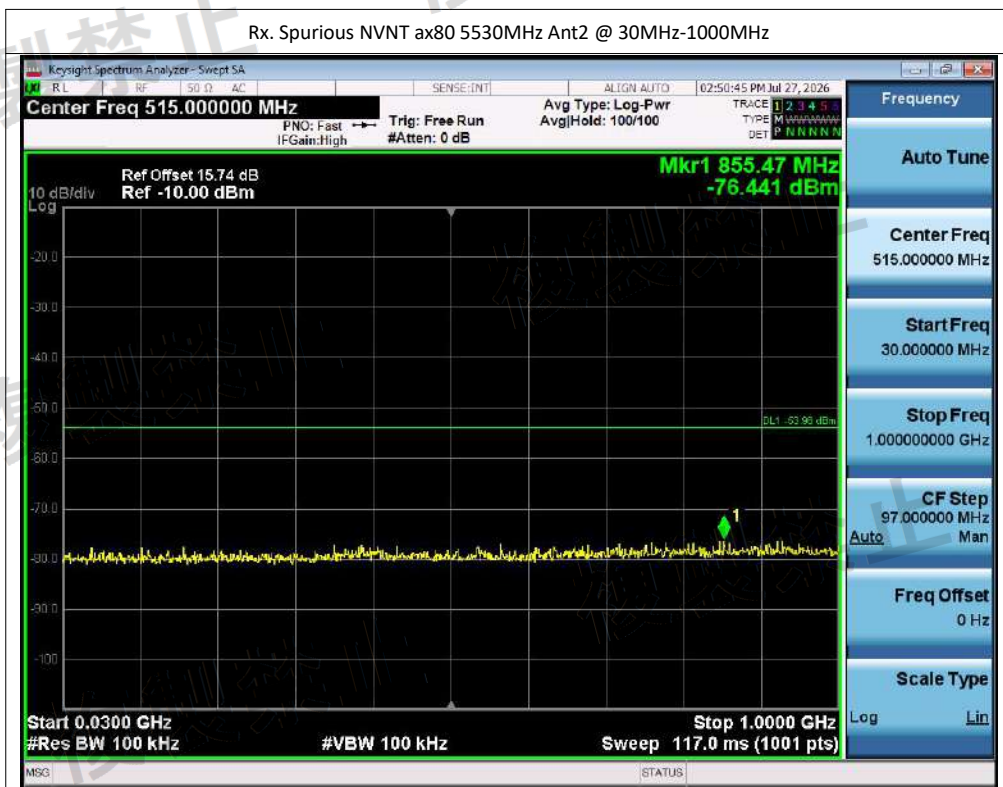


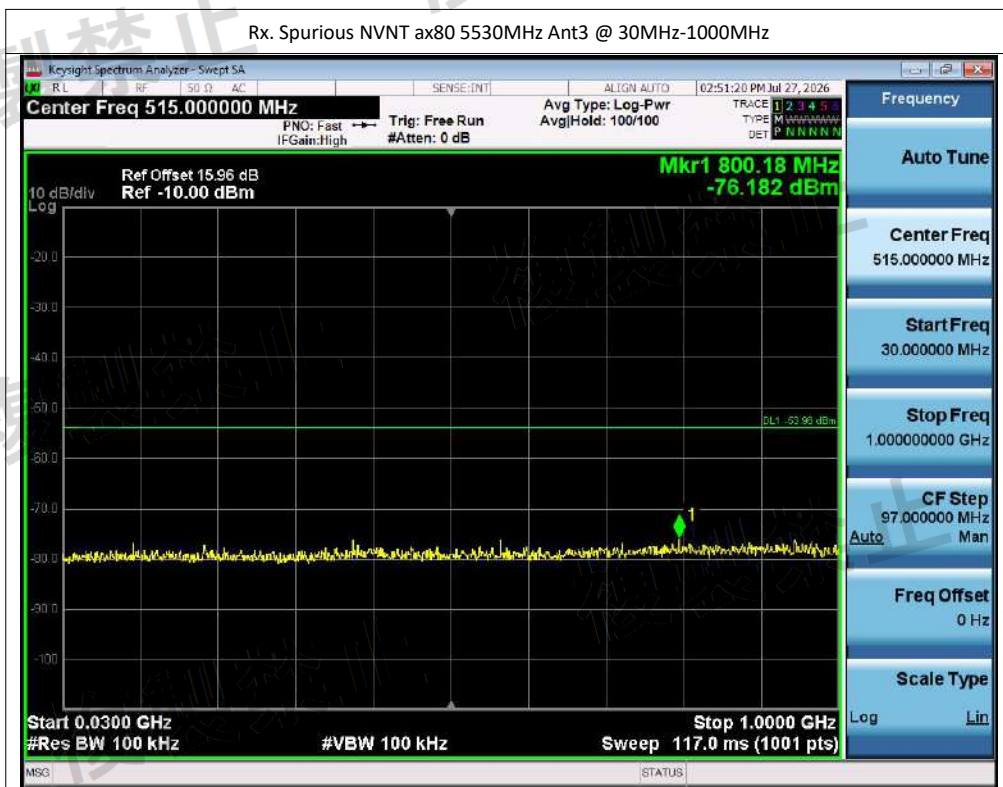


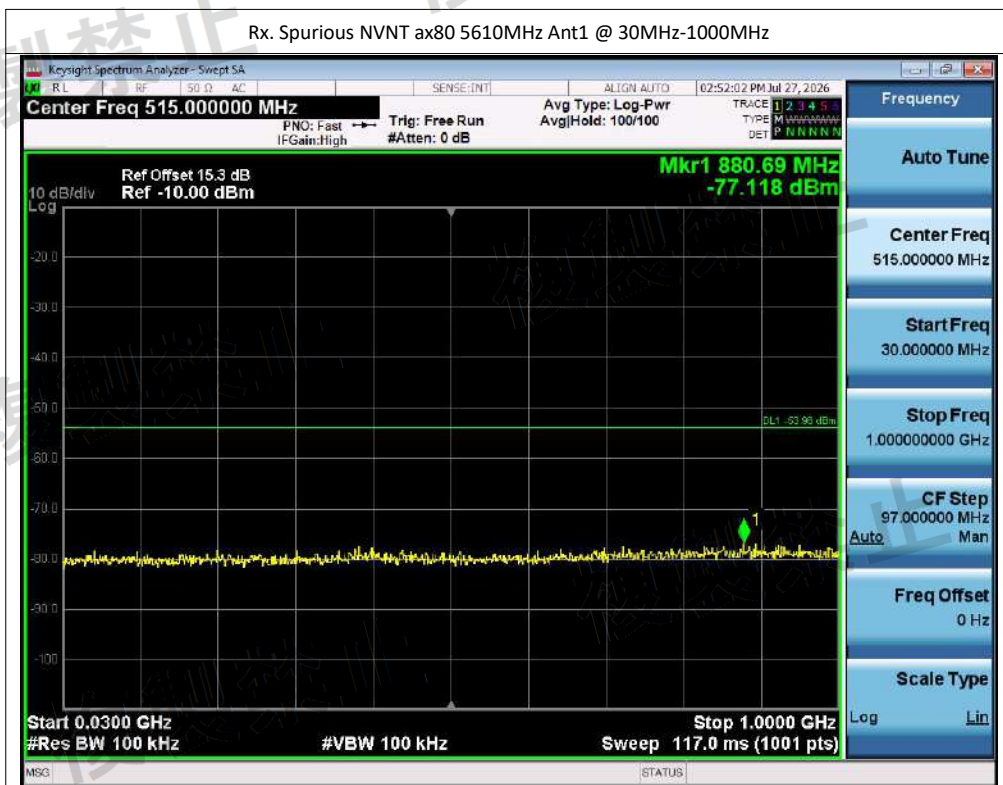


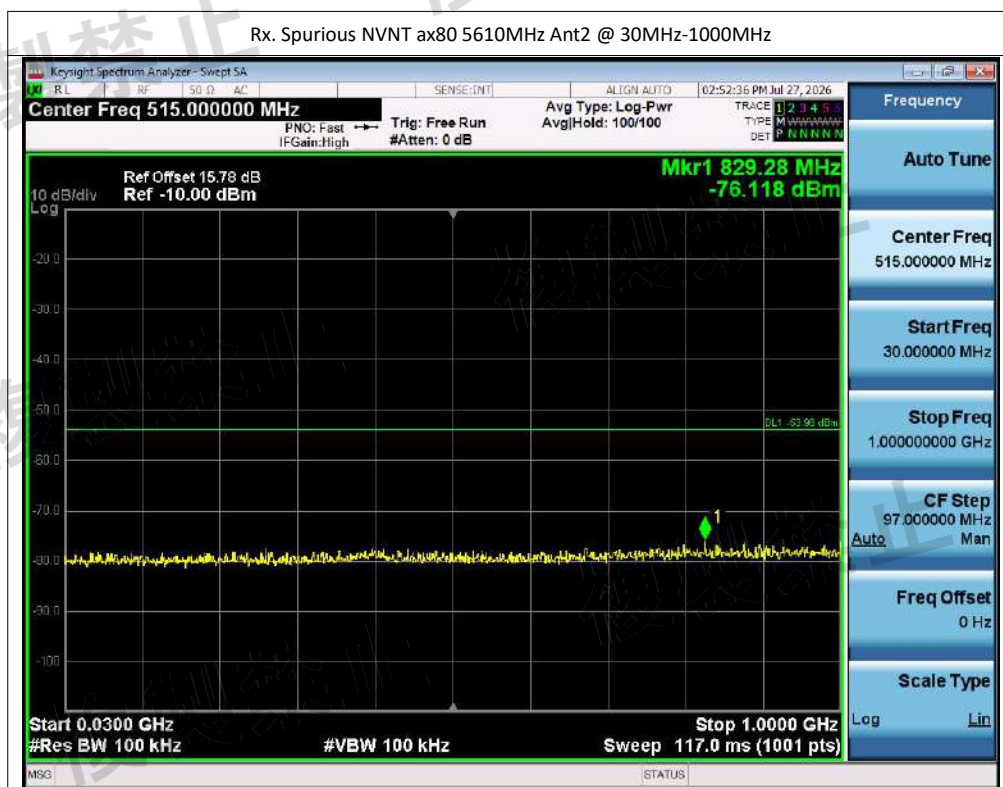


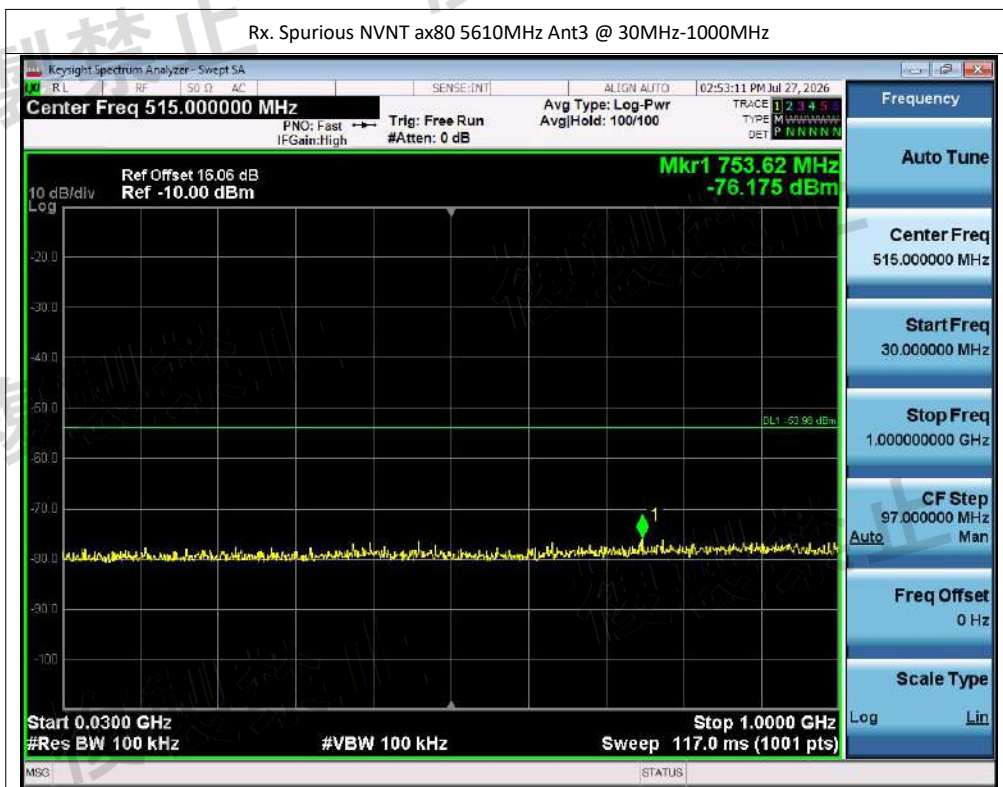


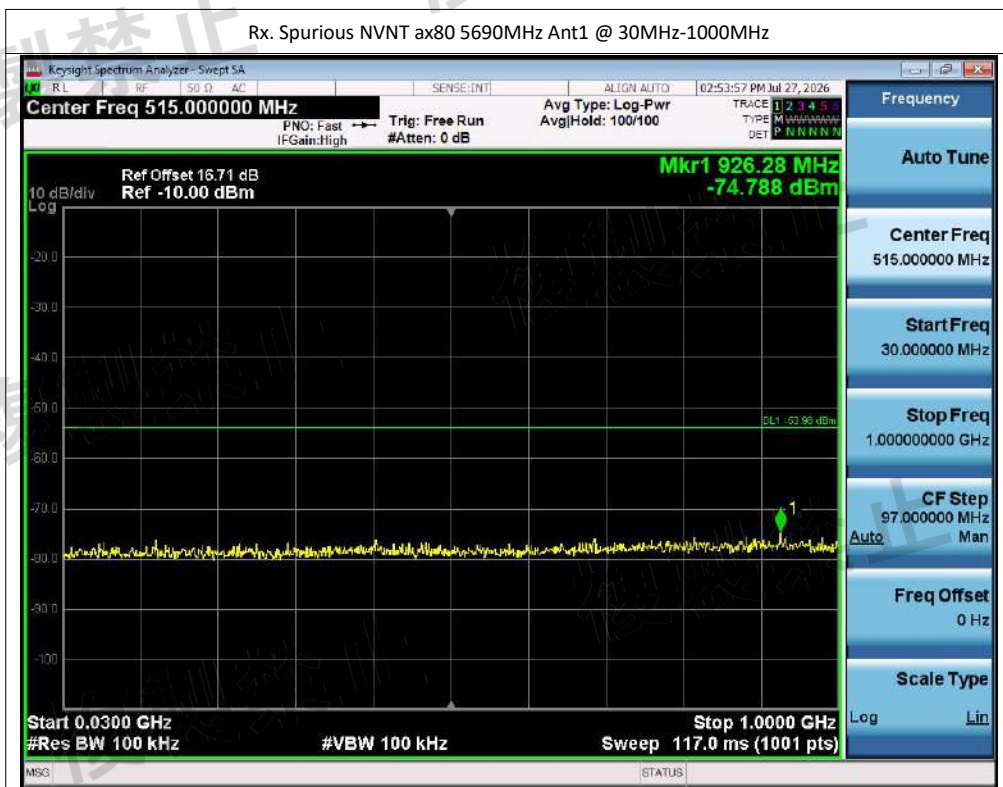


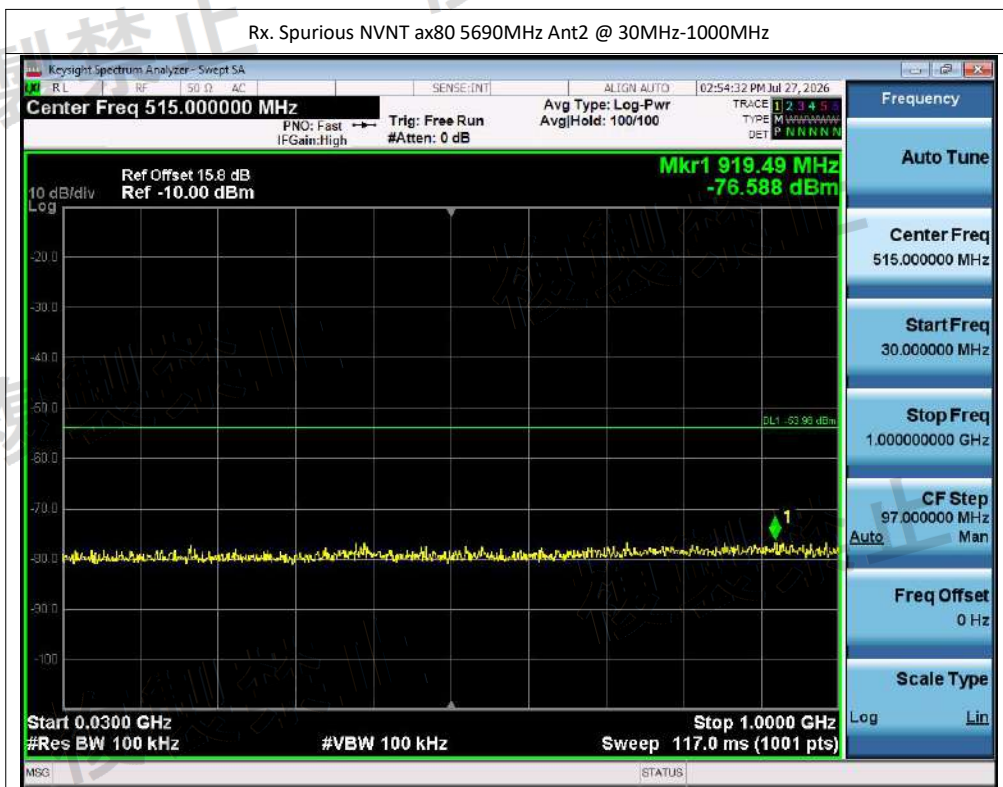



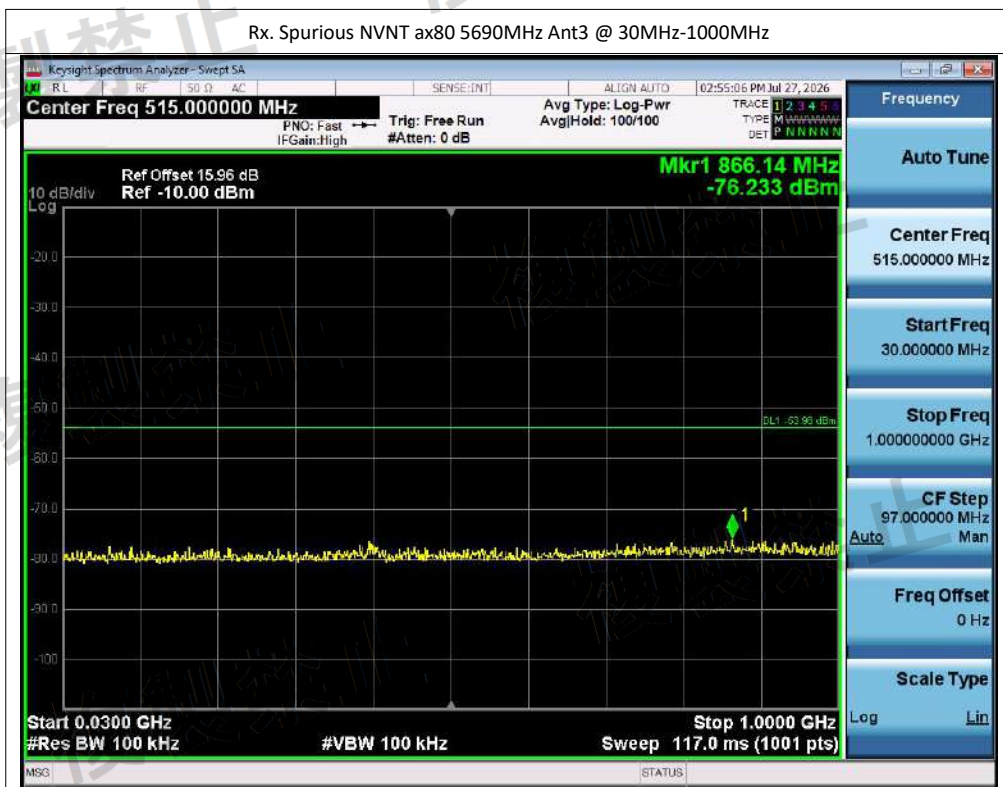


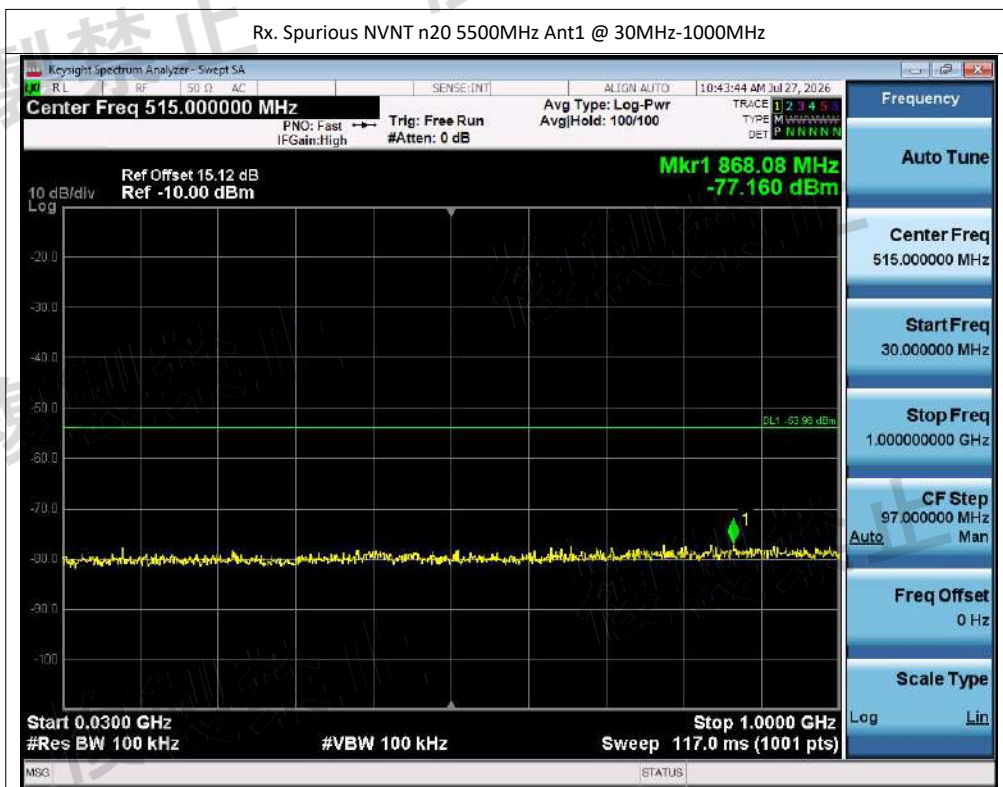


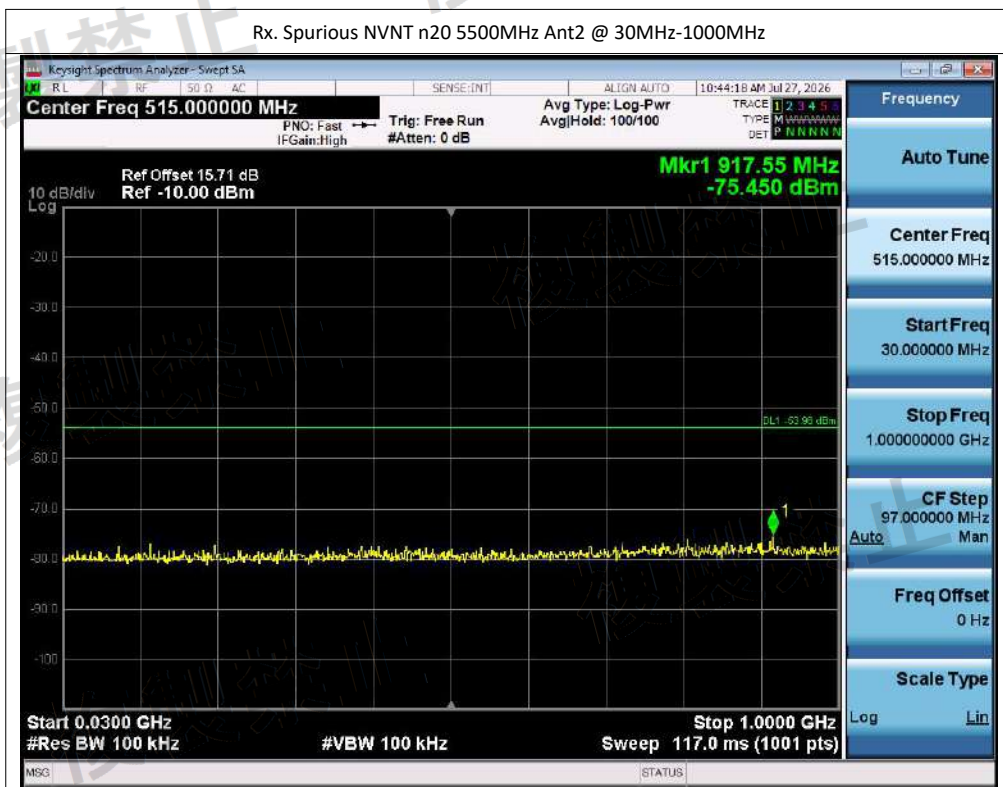


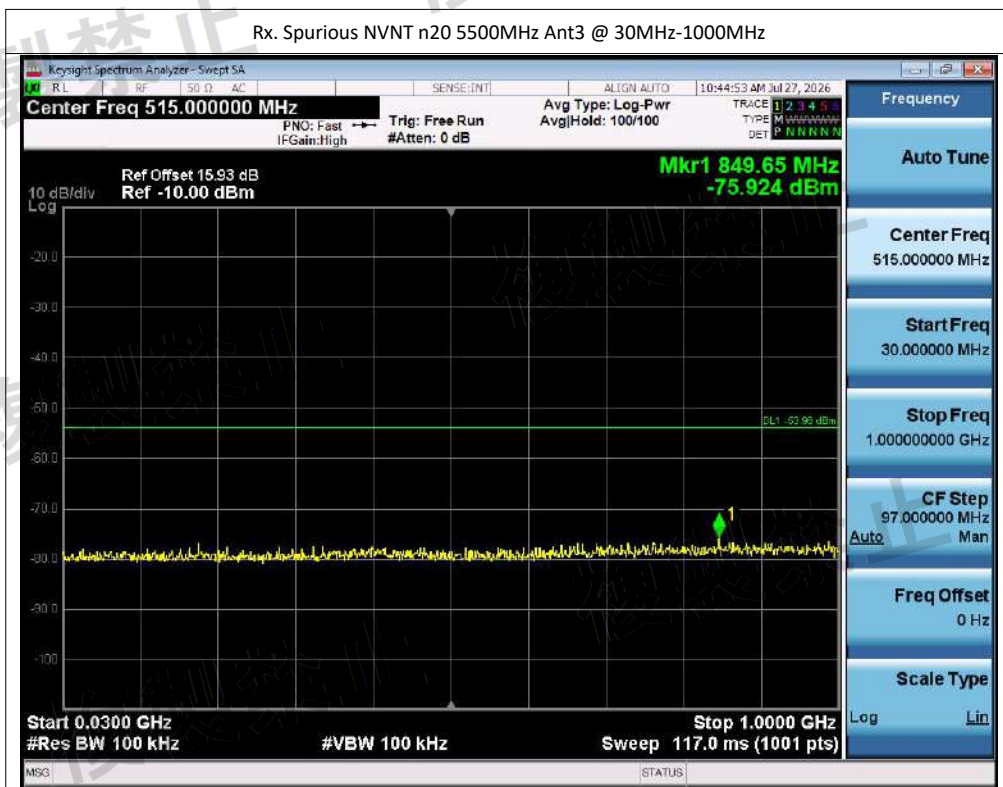


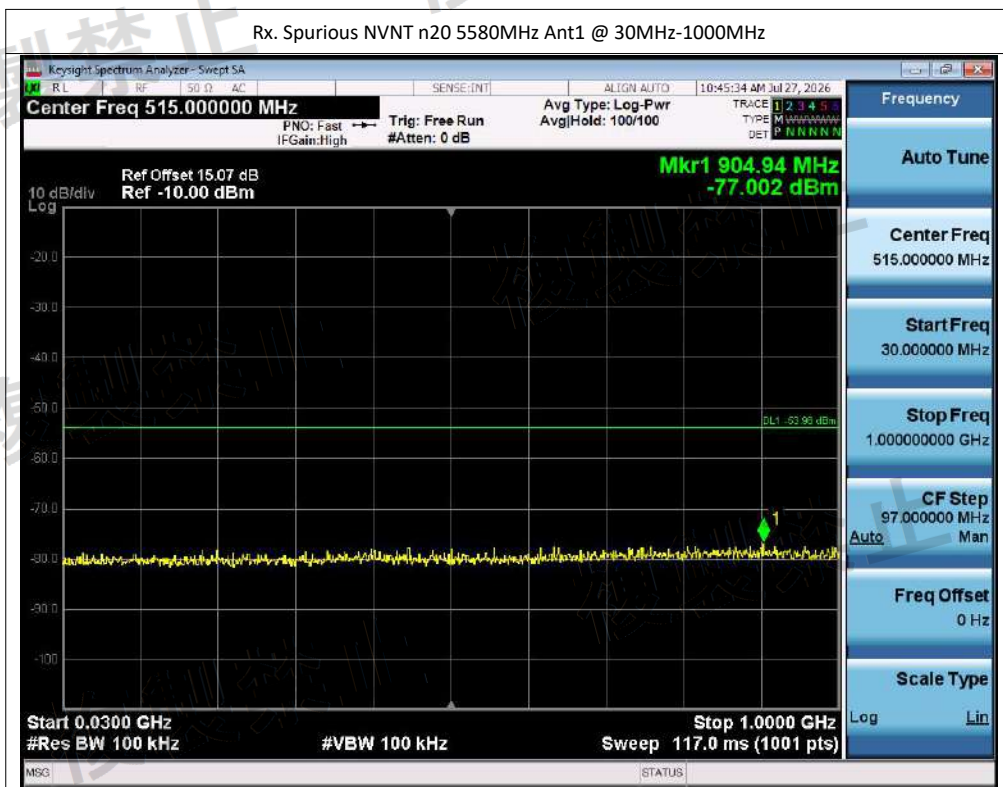


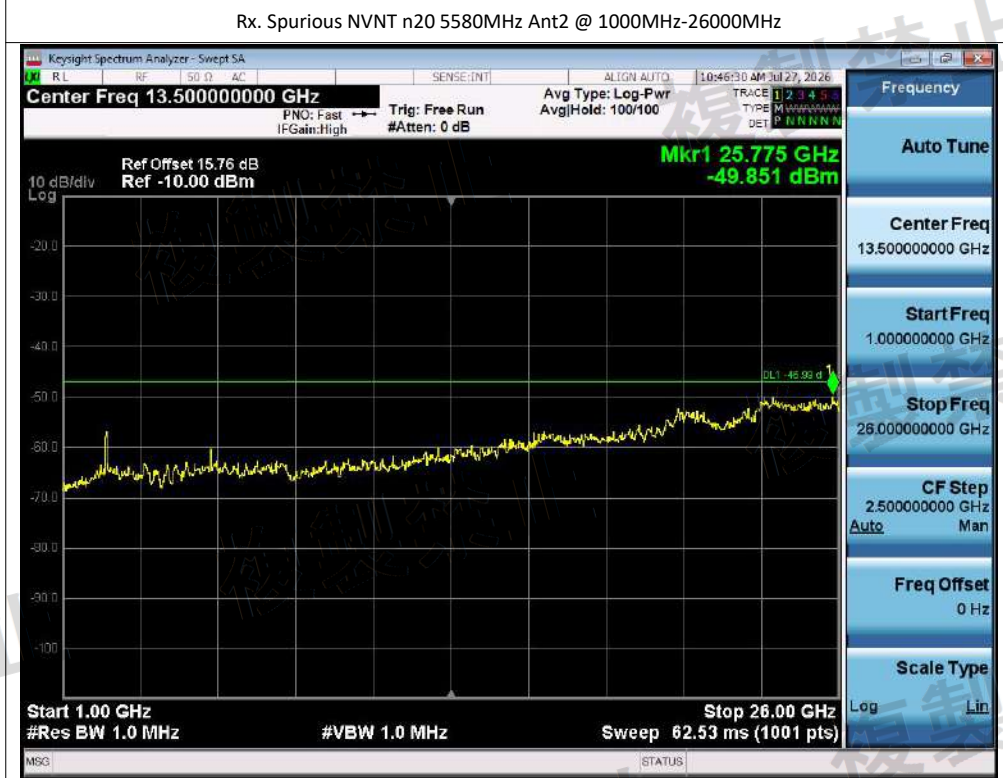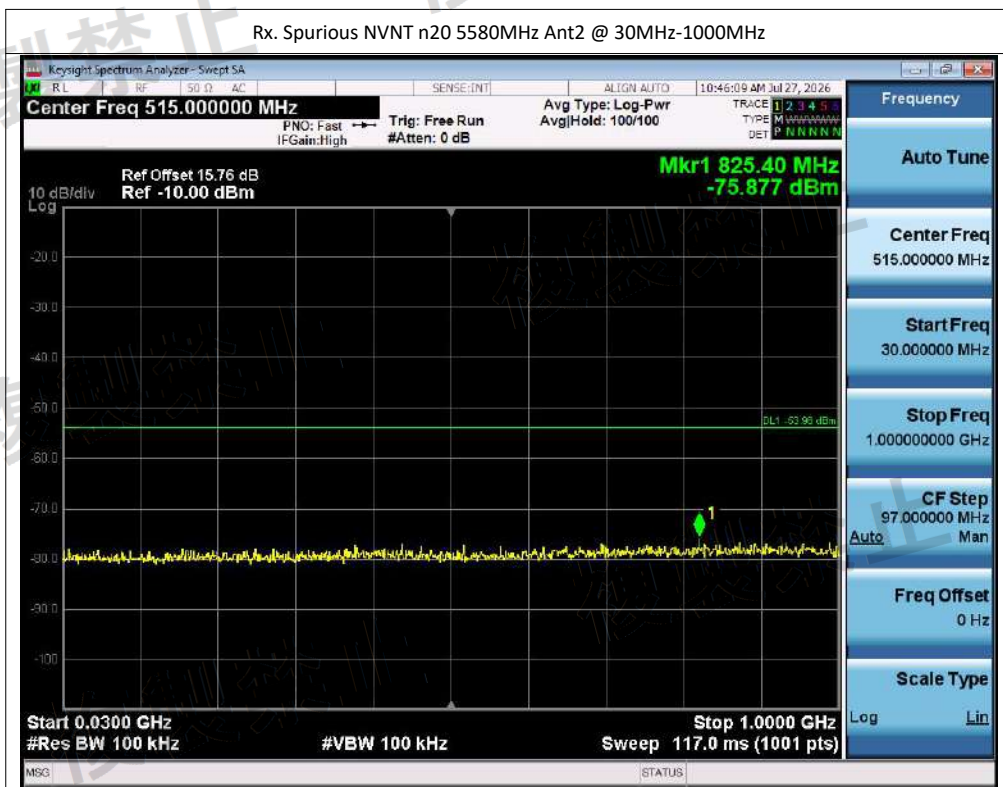


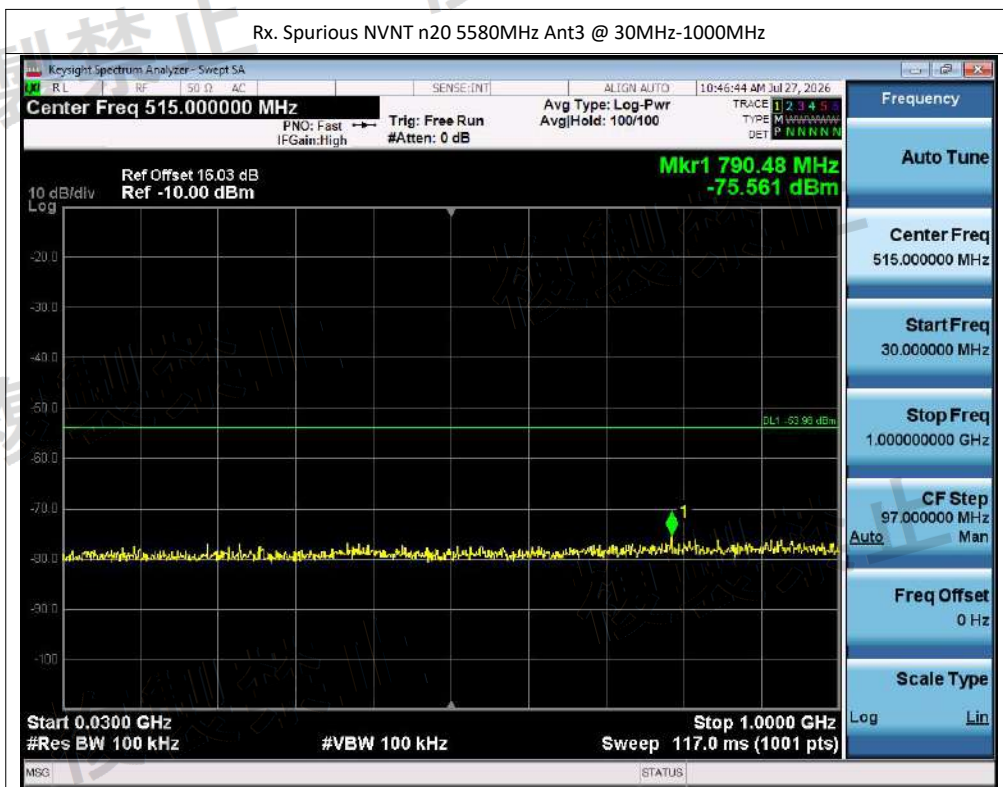


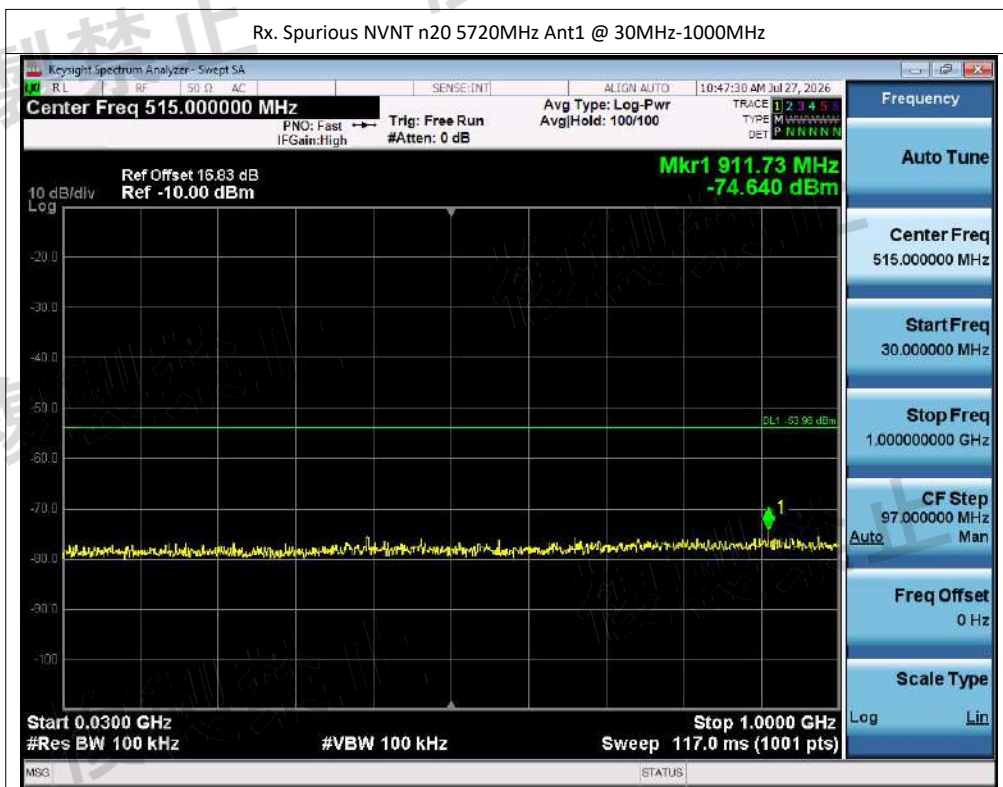


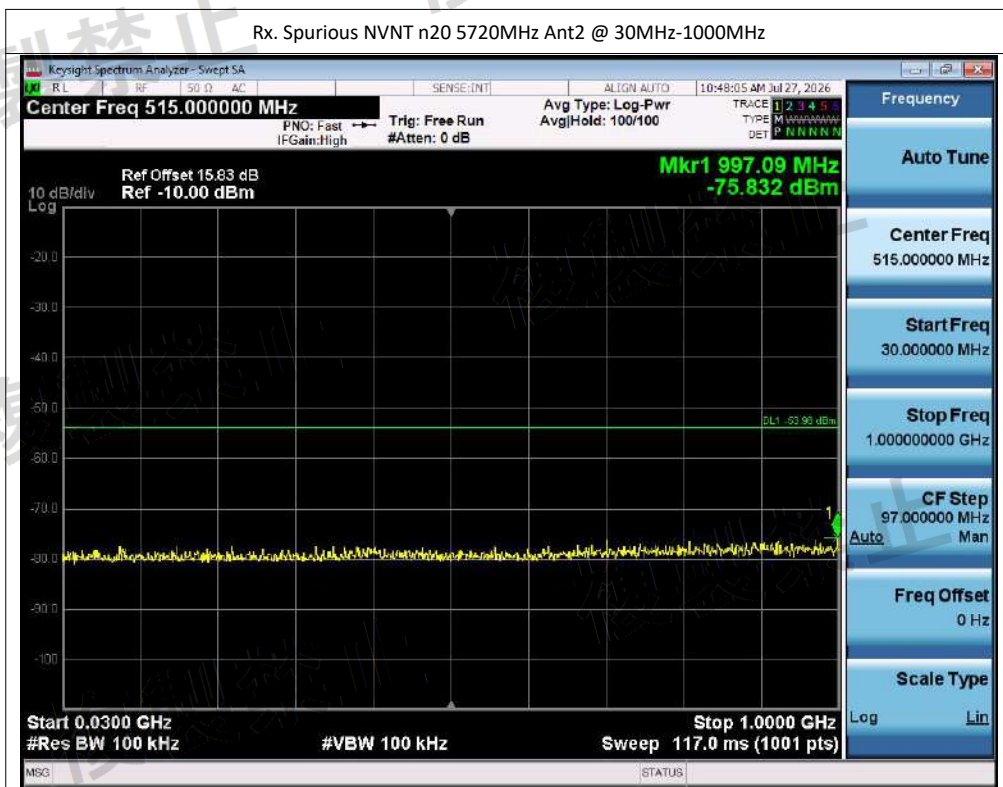


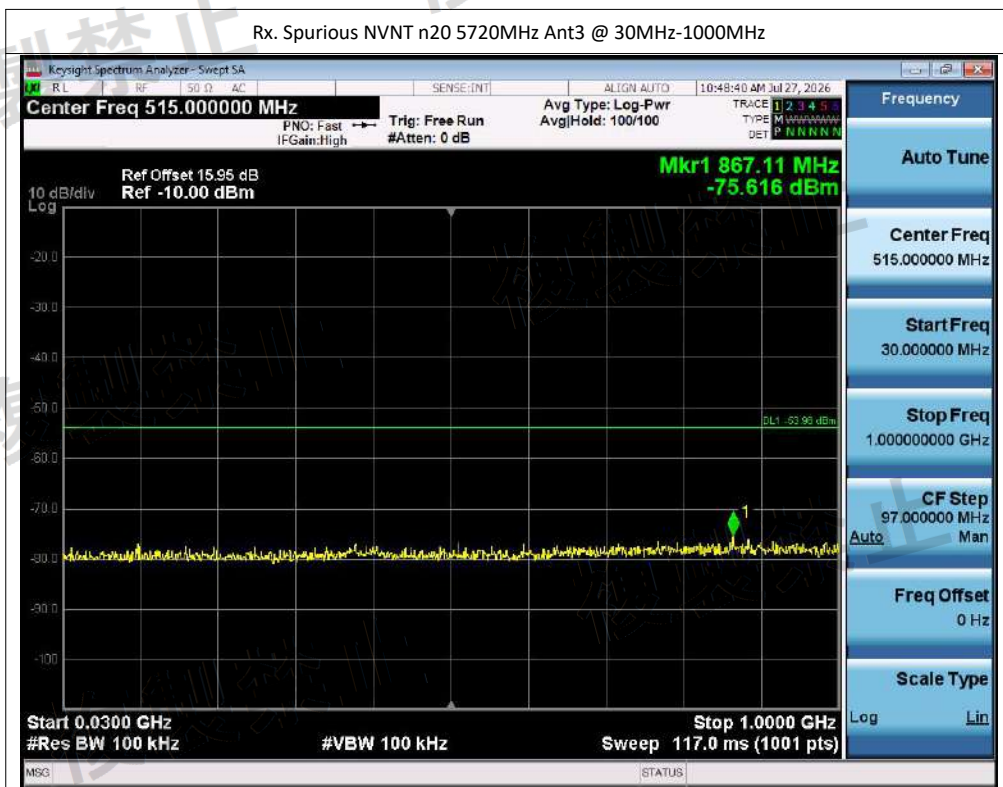


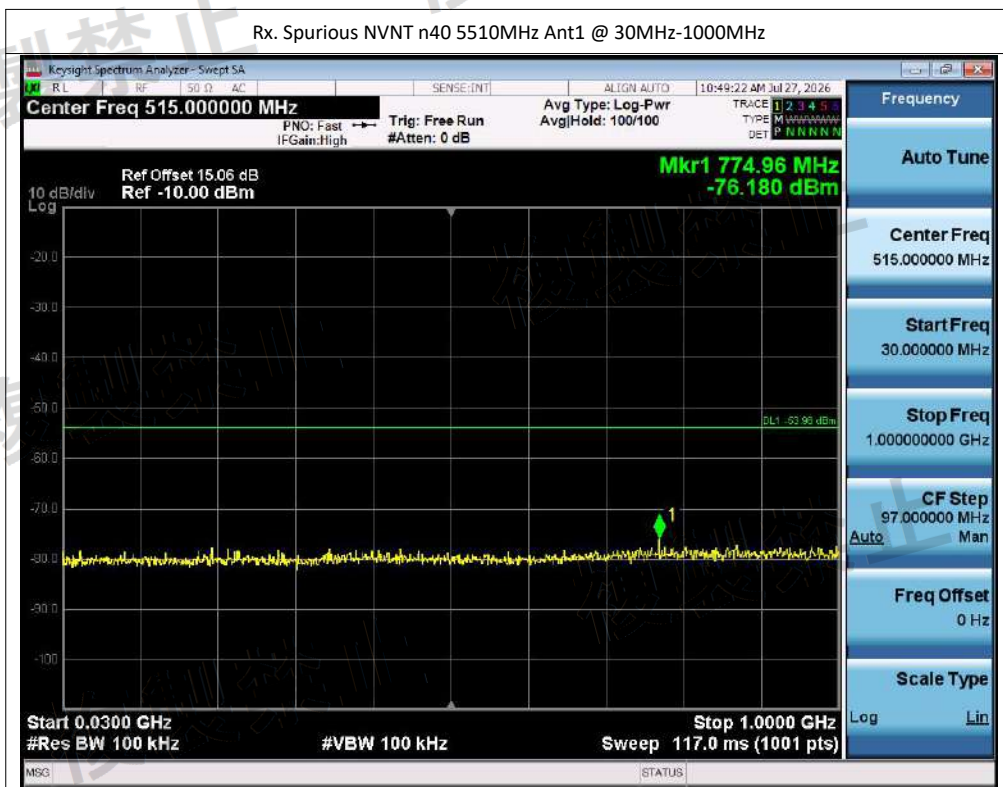


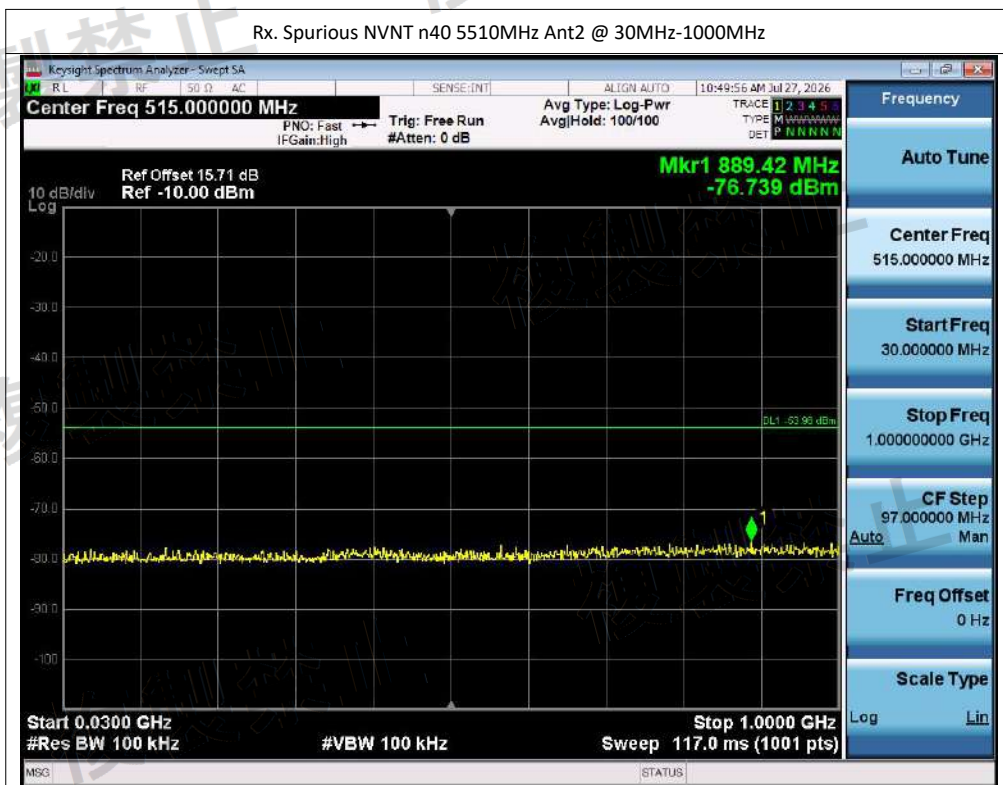


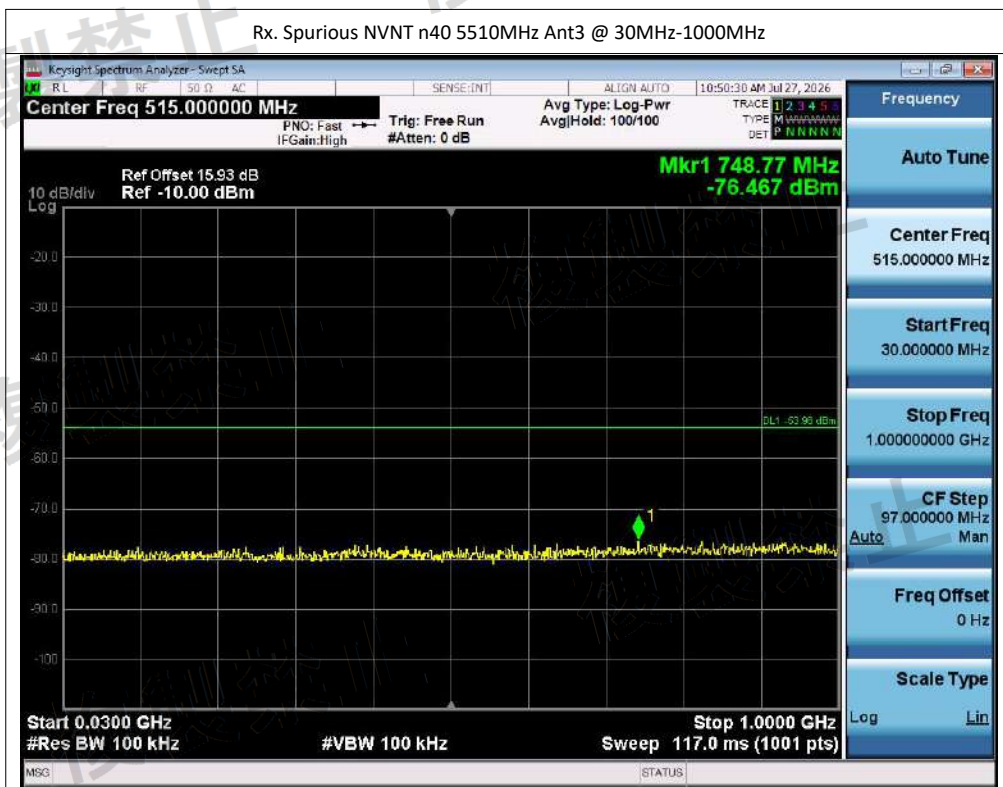


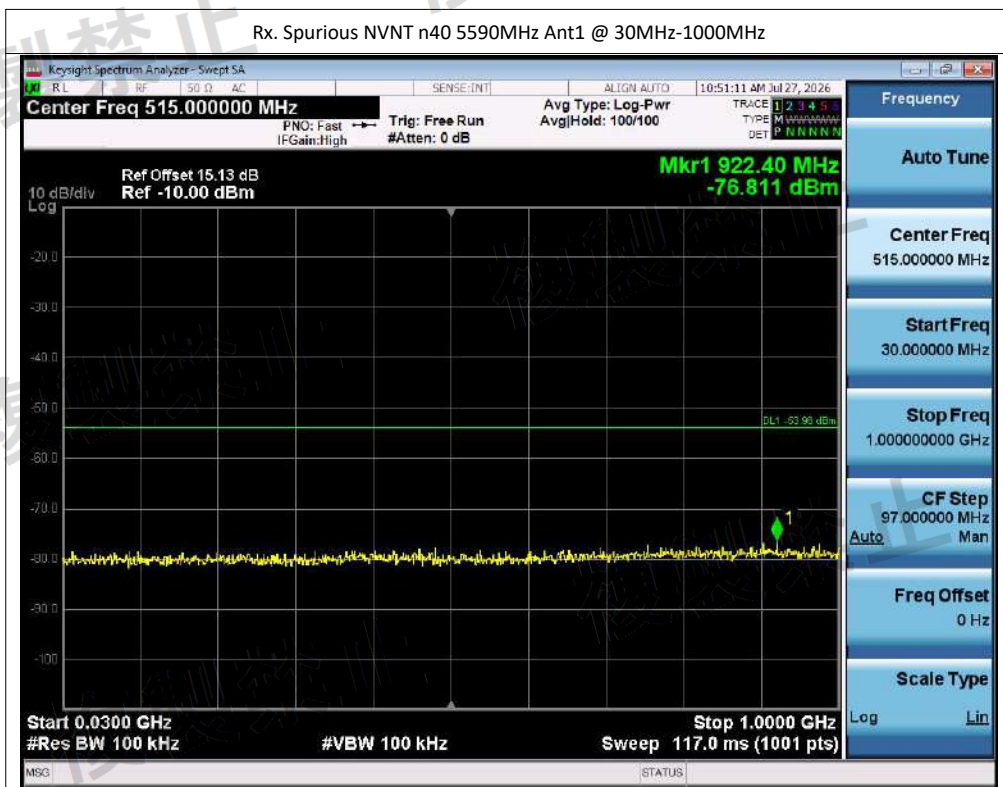


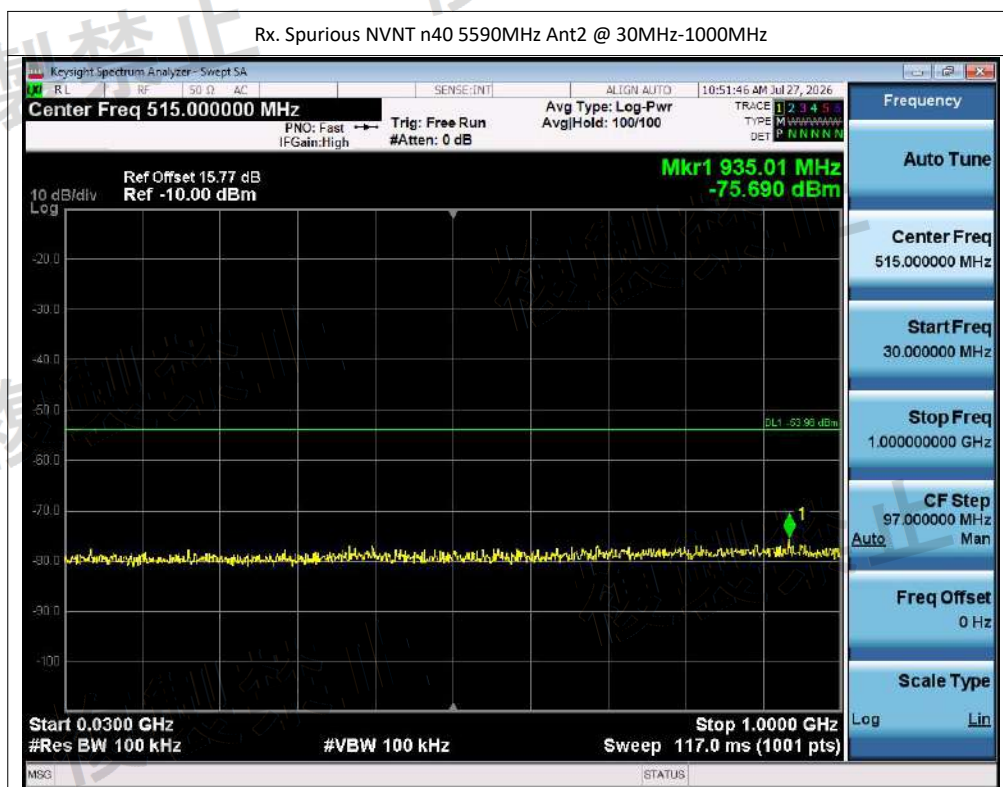

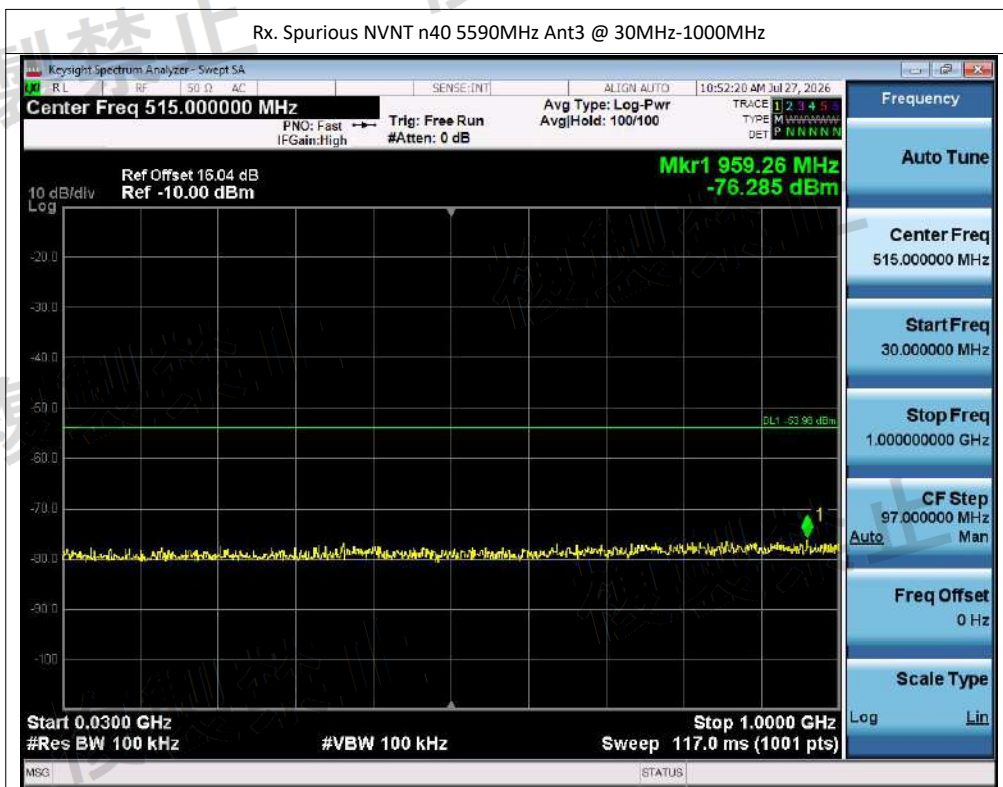

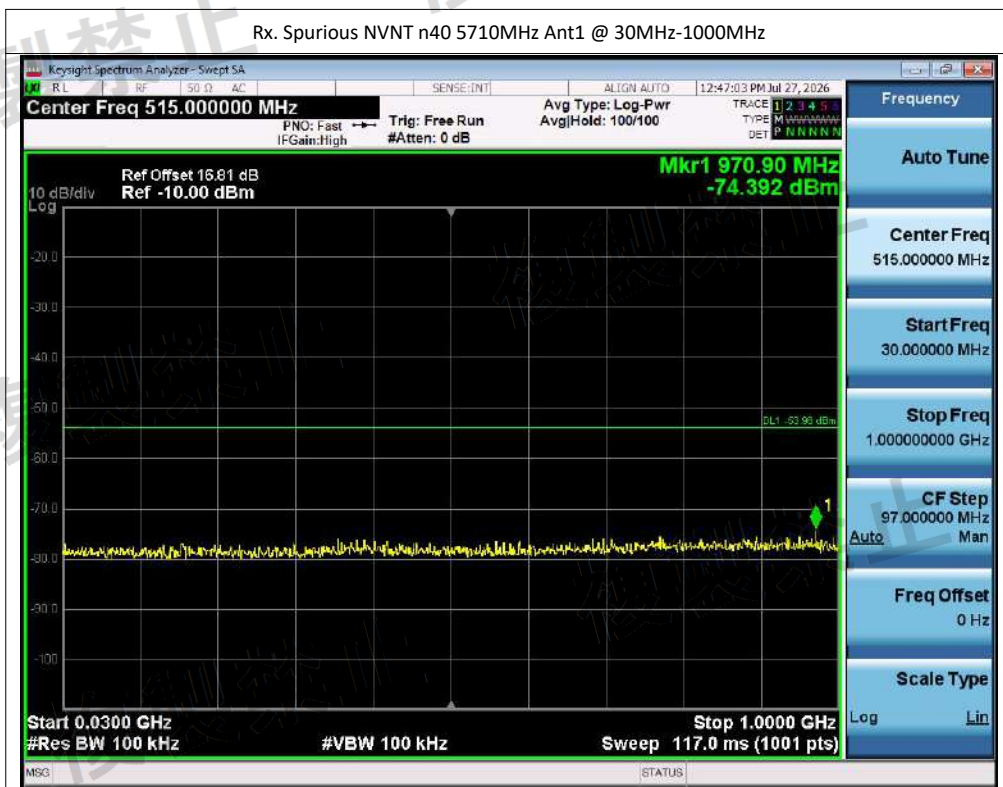

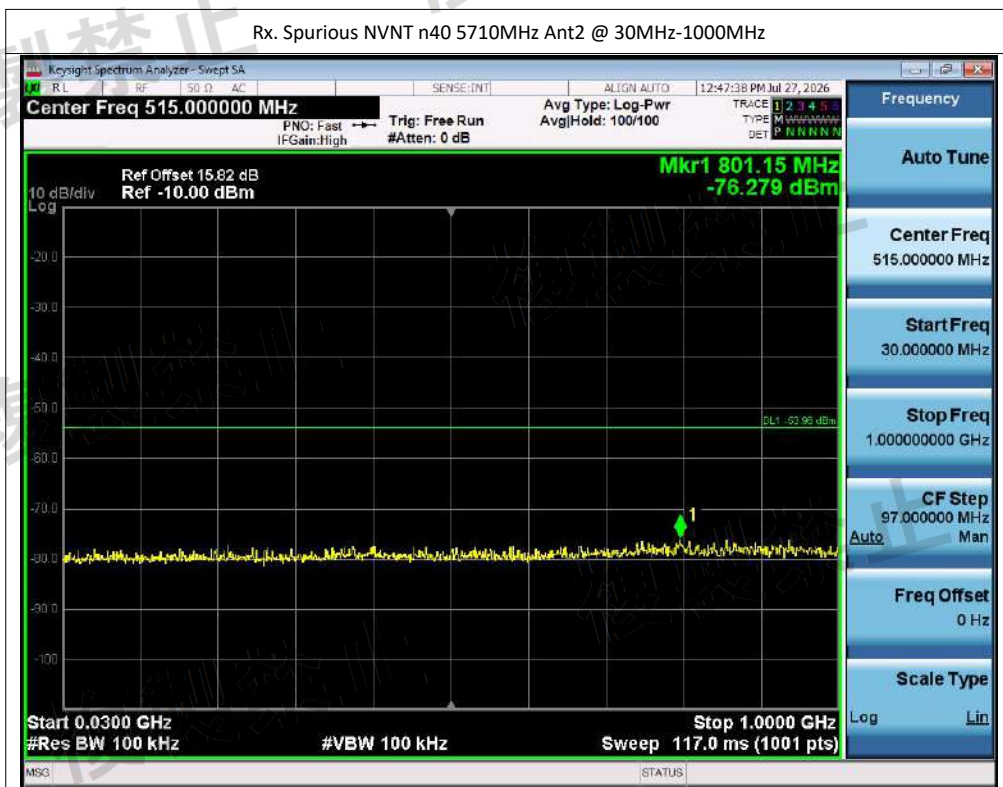

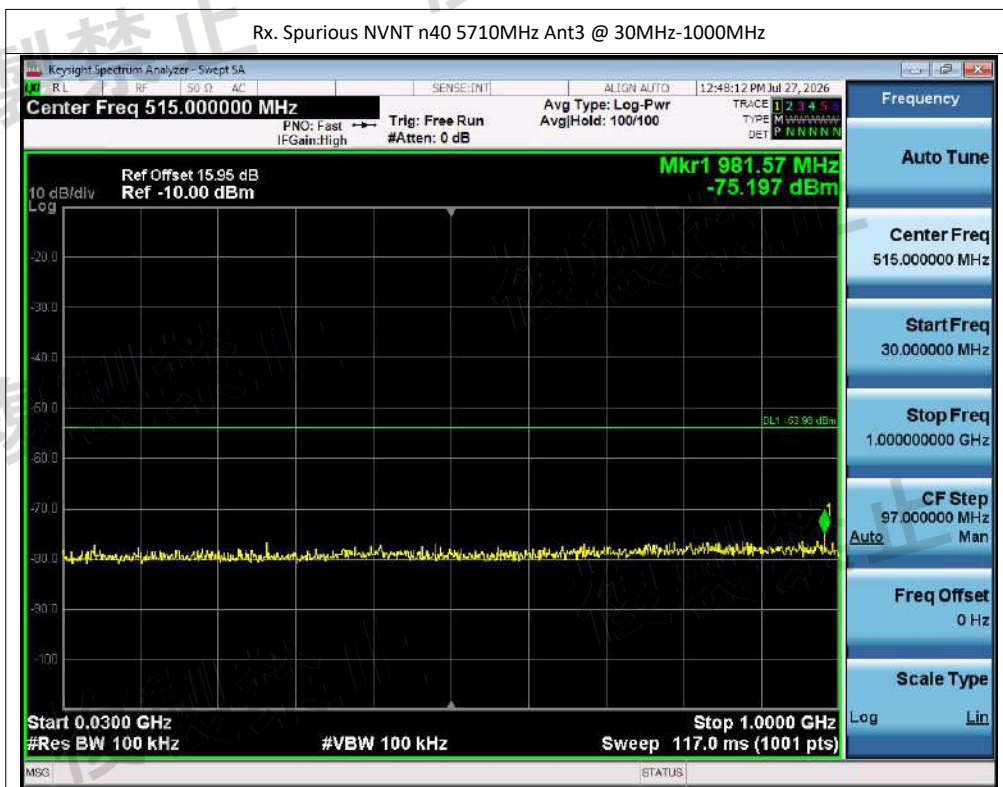

Adjacent Channel Emitted Power

Condition	Mode	Frequency (MHz)	Antenna	Offset (MHz)	Value (dBc)	Limit (dBc)	Verdict
NVNT	a	5500	Ant1	-20	-28.17	-25	Pass
NVNT	a	5500	Ant1	-40	-48.27	-40	Pass
NVNT	a	5500	Ant1	20	-26.88	-25	Pass
NVNT	a	5500	Ant1	40	-48.29	-40	Pass
NVNT	a	5580	Ant1	-20	-32.52	-25	Pass
NVNT	a	5580	Ant1	-40	-46.66	-40	Pass
NVNT	a	5580	Ant1	20	-33.55	-25	Pass
NVNT	a	5580	Ant1	40	-46.5	-40	Pass
NVNT	a	5720	Ant1	-20	-32.05	-25	Pass
NVNT	a	5720	Ant1	-40	-46.88	-40	Pass
NVNT	a	5720	Ant1	20	-33.95	-25	Pass
NVNT	a	5720	Ant1	40	-46	-40	Pass
NVNT	a	5500	Ant2	-20	-28.15	-25	Pass
NVNT	a	5500	Ant2	-40	-47.87	-40	Pass
NVNT	a	5500	Ant2	20	-26.94	-25	Pass
NVNT	a	5500	Ant2	40	-47.74	-40	Pass
NVNT	a	5580	Ant2	-20	-32.47	-25	Pass
NVNT	a	5580	Ant2	-40	-46.74	-40	Pass
NVNT	a	5580	Ant2	20	-33.71	-25	Pass
NVNT	a	5580	Ant2	40	-46.24	-40	Pass
NVNT	a	5720	Ant2	-20	-32.47	-25	Pass
NVNT	a	5720	Ant2	-40	-46.98	-40	Pass
NVNT	a	5720	Ant2	20	-33.57	-25	Pass
NVNT	a	5720	Ant2	40	-46.39	-40	Pass
NVNT	a	5500	Ant3	-20	-28.17	-25	Pass
NVNT	a	5500	Ant3	-40	-47.95	-40	Pass
NVNT	a	5500	Ant3	20	-26.8	-25	Pass
NVNT	a	5500	Ant3	40	-47.88	-40	Pass
NVNT	a	5580	Ant3	-20	-32.66	-25	Pass
NVNT	a	5580	Ant3	-40	-46.58	-40	Pass
NVNT	a	5580	Ant3	20	-33.58	-25	Pass
NVNT	a	5580	Ant3	40	-45.84	-40	Pass
NVNT	a	5720	Ant3	-20	-32.49	-25	Pass
NVNT	a	5720	Ant3	-40	-47.19	-40	Pass
NVNT	a	5720	Ant3	20	-33.73	-25	Pass
NVNT	a	5720	Ant3	40	-46.13	-40	Pass
NVNT	ac20	5500	Ant1	-20	-27.51	-25	Pass
NVNT	ac20	5500	Ant1	-40	-47.23	-40	Pass
NVNT	ac20	5500	Ant1	20	-26.04	-25	Pass

NVNT	ac20	5500	Ant1	40	-46.96	-40	Pass
NVNT	ac20	5500	Ant2	-20	-26.84	-25	Pass
NVNT	ac20	5500	Ant2	-40	-47.14	-40	Pass
NVNT	ac20	5500	Ant2	20	-26.08	-25	Pass
NVNT	ac20	5500	Ant2	40	-46.94	-40	Pass
NVNT	ac20	5500	Ant3	-20	-27.49	-25	Pass
NVNT	ac20	5500	Ant3	-40	-46.81	-40	Pass
NVNT	ac20	5500	Ant3	20	-25.88	-25	Pass
NVNT	ac20	5500	Ant3	40	-46.72	-40	Pass
NVNT	ac20	5580	Ant1	-20	-31.66	-25	Pass
NVNT	ac20	5580	Ant1	-40	-46.3	-40	Pass
NVNT	ac20	5580	Ant1	20	-32.54	-25	Pass
NVNT	ac20	5580	Ant1	40	-46.44	-40	Pass
NVNT	ac20	5580	Ant2	-20	-31.68	-25	Pass
NVNT	ac20	5580	Ant2	-40	-46.62	-40	Pass
NVNT	ac20	5580	Ant2	20	-33.18	-25	Pass
NVNT	ac20	5580	Ant2	40	-46.57	-40	Pass
NVNT	ac20	5580	Ant3	-20	-31.58	-25	Pass
NVNT	ac20	5580	Ant3	-40	-46.39	-40	Pass
NVNT	ac20	5580	Ant3	20	-33.24	-25	Pass
NVNT	ac20	5580	Ant3	40	-46.1	-40	Pass
NVNT	ac20	5720	Ant1	-20	-31.26	-25	Pass
NVNT	ac20	5720	Ant1	-40	-46.17	-40	Pass
NVNT	ac20	5720	Ant1	20	-32.73	-25	Pass
NVNT	ac20	5720	Ant1	40	-45.75	-40	Pass
NVNT	ac20	5720	Ant2	-20	-31.63	-25	Pass
NVNT	ac20	5720	Ant2	-40	-46.63	-40	Pass
NVNT	ac20	5720	Ant2	20	-33.17	-25	Pass
NVNT	ac20	5720	Ant2	40	-46.48	-40	Pass
NVNT	ac20	5720	Ant3	-20	-31.58	-25	Pass
NVNT	ac20	5720	Ant3	-40	-46.69	-40	Pass
NVNT	ac20	5720	Ant3	20	-33.26	-25	Pass
NVNT	ac20	5720	Ant3	40	-46.13	-40	Pass
NVNT	ac40	5510	Ant1	-40	-30.28	-25	Pass
NVNT	ac40	5510	Ant1	-80	-44.57	-40	Pass
NVNT	ac40	5510	Ant1	40	-27.5	-25	Pass
NVNT	ac40	5510	Ant1	80	-44.27	-40	Pass
NVNT	ac40	5510	Ant2	-40	-29.98	-25	Pass
NVNT	ac40	5510	Ant2	-80	-44.71	-40	Pass
NVNT	ac40	5510	Ant2	40	-27.42	-25	Pass
NVNT	ac40	5510	Ant2	80	-44.33	-40	Pass
NVNT	ac40	5510	Ant3	-40	-30.13	-25	Pass

NVNT	ac40	5510	Ant3	-80	-44.24	-40	Pass
NVNT	ac40	5510	Ant3	40	-27.69	-25	Pass
NVNT	ac40	5510	Ant3	80	-44.06	-40	Pass
NVNT	ac40	5590	Ant1	-40	-37.46	-25	Pass
NVNT	ac40	5590	Ant1	-80	-43.84	-40	Pass
NVNT	ac40	5590	Ant1	40	-38.11	-25	Pass
NVNT	ac40	5590	Ant1	80	-44.28	-40	Pass
NVNT	ac40	5590	Ant2	-40	-37.27	-25	Pass
NVNT	ac40	5590	Ant2	-80	-43.97	-40	Pass
NVNT	ac40	5590	Ant2	40	-38.53	-25	Pass
NVNT	ac40	5590	Ant2	80	-44.39	-40	Pass
NVNT	ac40	5590	Ant3	-40	-36.75	-25	Pass
NVNT	ac40	5590	Ant3	-80	-43.47	-40	Pass
NVNT	ac40	5590	Ant3	40	-38.16	-25	Pass
NVNT	ac40	5590	Ant3	80	-44.07	-40	Pass
NVNT	ac40	5710	Ant1	-40	-37.57	-25	Pass
NVNT	ac40	5710	Ant1	-80	-44.49	-40	Pass
NVNT	ac40	5710	Ant1	40	-38.92	-25	Pass
NVNT	ac40	5710	Ant1	80	-44.53	-40	Pass
NVNT	ac40	5710	Ant2	-40	-37.85	-25	Pass
NVNT	ac40	5710	Ant2	-80	-44.71	-40	Pass
NVNT	ac40	5710	Ant2	40	-38.96	-25	Pass
NVNT	ac40	5710	Ant2	80	-44.75	-40	Pass
NVNT	ac40	5710	Ant3	-40	-39.11	-25	Pass
NVNT	ac40	5710	Ant3	-80	-44.28	-40	Pass
NVNT	ac40	5710	Ant3	40	-38.73	-25	Pass
NVNT	ac40	5710	Ant3	80	-44.49	-40	Pass
NVNT	ac80	5530	Ant1	-80	-32.67	-25	Pass
NVNT	ac80	5530	Ant1	-160	-41.51	-40	Pass
NVNT	ac80	5530	Ant1	80	-28.31	-25	Pass
NVNT	ac80	5530	Ant1	160	-41.34	-40	Pass
NVNT	ac80	5530	Ant2	-80	-32.34	-25	Pass
NVNT	ac80	5530	Ant2	-160	-41.73	-40	Pass
NVNT	ac80	5530	Ant2	80	-28.24	-25	Pass
NVNT	ac80	5530	Ant2	160	-41.38	-40	Pass
NVNT	ac80	5530	Ant3	-80	-32.39	-25	Pass
NVNT	ac80	5530	Ant3	-160	-41.2	-40	Pass
NVNT	ac80	5530	Ant3	80	-28.11	-25	Pass
NVNT	ac80	5530	Ant3	160	-40.95	-40	Pass
NVNT	ac80	5610	Ant1	-80	-38.24	-25	Pass
NVNT	ac80	5610	Ant1	-160	-41.07	-40	Pass
NVNT	ac80	5610	Ant1	80	-39.36	-25	Pass

NVNT	ac80	5610	Ant1	160	-41.44	-40	Pass
NVNT	ac80	5610	Ant2	-80	-38.55	-25	Pass
NVNT	ac80	5610	Ant2	-160	-41.31	-40	Pass
NVNT	ac80	5610	Ant2	80	-39.3	-25	Pass
NVNT	ac80	5610	Ant2	160	-41.72	-40	Pass
NVNT	ac80	5610	Ant3	-80	-38.23	-25	Pass
NVNT	ac80	5610	Ant3	-160	-40.85	-40	Pass
NVNT	ac80	5610	Ant3	80	-39.04	-25	Pass
NVNT	ac80	5610	Ant3	160	-41.18	-40	Pass
NVNT	ac80	5690	Ant1	-80	-39.06	-25	Pass
NVNT	ac80	5690	Ant1	-160	-40.69	-40	Pass
NVNT	ac80	5690	Ant1	80	-39.37	-25	Pass
NVNT	ac80	5690	Ant1	160	-41.11	-40	Pass
NVNT	ac80	5690	Ant2	-80	-39.66	-25	Pass
NVNT	ac80	5690	Ant2	-160	-41.1	-40	Pass
NVNT	ac80	5690	Ant2	80	-39.71	-25	Pass
NVNT	ac80	5690	Ant2	160	-41.47	-40	Pass
NVNT	ac80	5690	Ant3	-80	-39.12	-25	Pass
NVNT	ac80	5690	Ant3	-160	-40.44	-40	Pass
NVNT	ac80	5690	Ant3	80	-39.28	-25	Pass
NVNT	ac80	5690	Ant3	160	-40.72	-40	Pass
NVNT	ax20	5500	Ant1	-20	-27.27	-25	Pass
NVNT	ax20	5500	Ant1	-40	-48.16	-40	Pass
NVNT	ax20	5500	Ant1	20	-25.87	-25	Pass
NVNT	ax20	5500	Ant1	40	-48.09	-40	Pass
NVNT	ax20	5500	Ant2	-20	-27.32	-25	Pass
NVNT	ax20	5500	Ant2	-40	-48.29	-40	Pass
NVNT	ax20	5500	Ant2	20	-26.02	-25	Pass
NVNT	ax20	5500	Ant2	40	-48.24	-40	Pass
NVNT	ax20	5500	Ant3	-20	-27.03	-25	Pass
NVNT	ax20	5500	Ant3	-40	-47.66	-40	Pass
NVNT	ax20	5500	Ant3	20	-26.07	-25	Pass
NVNT	ax20	5500	Ant3	40	-47.69	-40	Pass
NVNT	ax20	5580	Ant1	-20	-30.13	-25	Pass
NVNT	ax20	5580	Ant1	-40	-47.36	-40	Pass
NVNT	ax20	5580	Ant1	20	-30.96	-25	Pass
NVNT	ax20	5580	Ant1	40	-47.08	-40	Pass
NVNT	ax20	5580	Ant2	-20	-29.99	-25	Pass
NVNT	ax20	5580	Ant2	-40	-47.7	-40	Pass
NVNT	ax20	5580	Ant2	20	-31.11	-25	Pass
NVNT	ax20	5580	Ant2	40	-47.51	-40	Pass
NVNT	ax20	5580	Ant3	-20	-30.03	-25	Pass

NVNT	ax20	5580	Ant3	-40	-47.52	-40	Pass
NVNT	ax20	5580	Ant3	20	-30.7	-25	Pass
NVNT	ax20	5580	Ant3	40	-47.24	-40	Pass
NVNT	ax20	5720	Ant1	-20	-29.14	-25	Pass
NVNT	ax20	5720	Ant1	-40	-47.83	-40	Pass
NVNT	ax20	5720	Ant1	20	-31.21	-25	Pass
NVNT	ax20	5720	Ant1	40	-47.14	-40	Pass
NVNT	ax20	5720	Ant2	-20	-30.03	-25	Pass
NVNT	ax20	5720	Ant2	-40	-47.93	-40	Pass
NVNT	ax20	5720	Ant2	20	-31.1	-25	Pass
NVNT	ax20	5720	Ant2	40	-47.54	-40	Pass
NVNT	ax20	5720	Ant3	-20	-29.89	-25	Pass
NVNT	ax20	5720	Ant3	-40	-48.14	-40	Pass
NVNT	ax20	5720	Ant3	20	-31.85	-25	Pass
NVNT	ax20	5720	Ant3	40	-47.47	-40	Pass
NVNT	ax40	5510	Ant1	-40	-32.39	-25	Pass
NVNT	ax40	5510	Ant1	-80	-45.92	-40	Pass
NVNT	ax40	5510	Ant1	40	-29.29	-25	Pass
NVNT	ax40	5510	Ant1	80	-45.58	-40	Pass
NVNT	ax40	5510	Ant2	-40	-31.41	-25	Pass
NVNT	ax40	5510	Ant2	-80	-45.92	-40	Pass
NVNT	ax40	5510	Ant2	40	-29.37	-25	Pass
NVNT	ax40	5510	Ant2	80	-45.7	-40	Pass
NVNT	ax40	5510	Ant3	-40	-32.05	-25	Pass
NVNT	ax40	5510	Ant3	-80	-45.51	-40	Pass
NVNT	ax40	5510	Ant3	40	-29.4	-25	Pass
NVNT	ax40	5510	Ant3	80	-45.13	-40	Pass
NVNT	ax40	5590	Ant1	-40	-40.55	-25	Pass
NVNT	ax40	5590	Ant1	-80	-45.2	-40	Pass
NVNT	ax40	5590	Ant1	40	-42.65	-25	Pass
NVNT	ax40	5590	Ant1	80	-45.66	-40	Pass
NVNT	ax40	5590	Ant2	-40	-40.42	-25	Pass
NVNT	ax40	5590	Ant2	-80	-45.19	-40	Pass
NVNT	ax40	5590	Ant2	40	-42.61	-25	Pass
NVNT	ax40	5590	Ant2	80	-45.74	-40	Pass
NVNT	ax40	5590	Ant3	-40	-40.21	-25	Pass
NVNT	ax40	5590	Ant3	-80	-44.96	-40	Pass
NVNT	ax40	5590	Ant3	40	-42.49	-25	Pass
NVNT	ax40	5590	Ant3	80	-45.44	-40	Pass
NVNT	ax40	5710	Ant1	-40	-40.83	-25	Pass
NVNT	ax40	5710	Ant1	-80	-45.46	-40	Pass
NVNT	ax40	5710	Ant1	40	-42.29	-25	Pass

NVNT	ax40	5710	Ant1	80	-45.55	-40	Pass
NVNT	ax40	5710	Ant2	-40	-41.29	-25	Pass
NVNT	ax40	5710	Ant2	-80	-45.91	-40	Pass
NVNT	ax40	5710	Ant2	40	-42.58	-25	Pass
NVNT	ax40	5710	Ant2	80	-46	-40	Pass
NVNT	ax40	5710	Ant3	-40	-42.25	-25	Pass
NVNT	ax40	5710	Ant3	-80	-45.39	-40	Pass
NVNT	ax40	5710	Ant3	40	-42.44	-25	Pass
NVNT	ax40	5710	Ant3	80	-45.63	-40	Pass
NVNT	ax80	5530	Ant1	-80	-34.06	-25	Pass
NVNT	ax80	5530	Ant1	-160	-42.24	-40	Pass
NVNT	ax80	5530	Ant1	80	-29.47	-25	Pass
NVNT	ax80	5530	Ant1	160	-42.01	-40	Pass
NVNT	ax80	5530	Ant2	-80	-33.7	-25	Pass
NVNT	ax80	5530	Ant2	-160	-42.14	-40	Pass
NVNT	ax80	5530	Ant2	80	-29.49	-25	Pass
NVNT	ax80	5530	Ant2	160	-41.97	-40	Pass
NVNT	ax80	5530	Ant3	-80	-33.79	-25	Pass
NVNT	ax80	5530	Ant3	-160	-41.79	-40	Pass
NVNT	ax80	5530	Ant3	80	-29.3	-25	Pass
NVNT	ax80	5530	Ant3	160	-41.65	-40	Pass
NVNT	ax80	5610	Ant1	-80	-38.73	-25	Pass
NVNT	ax80	5610	Ant1	-160	-41.7	-40	Pass
NVNT	ax80	5610	Ant1	80	-39.34	-25	Pass
NVNT	ax80	5610	Ant1	160	-42.16	-40	Pass
NVNT	ax80	5610	Ant2	-80	-38.73	-25	Pass
NVNT	ax80	5610	Ant2	-160	-41.78	-40	Pass
NVNT	ax80	5610	Ant2	80	-39.35	-25	Pass
NVNT	ax80	5610	Ant2	160	-42.15	-40	Pass
NVNT	ax80	5610	Ant3	-80	-38.51	-25	Pass
NVNT	ax80	5610	Ant3	-160	-41.35	-40	Pass
NVNT	ax80	5610	Ant3	80	-39.31	-25	Pass
NVNT	ax80	5610	Ant3	160	-41.85	-40	Pass
NVNT	ax80	5690	Ant1	-80	-39.41	-25	Pass
NVNT	ax80	5690	Ant1	-160	-41.36	-40	Pass
NVNT	ax80	5690	Ant1	80	-39.65	-25	Pass
NVNT	ax80	5690	Ant1	160	-41.72	-40	Pass
NVNT	ax80	5690	Ant2	-80	-39.66	-25	Pass
NVNT	ax80	5690	Ant2	-160	-41.63	-40	Pass
NVNT	ax80	5690	Ant2	80	-39.85	-25	Pass
NVNT	ax80	5690	Ant2	160	-41.79	-40	Pass
NVNT	ax80	5690	Ant3	-80	-39.52	-25	Pass

NVNT	ax80	5690	Ant3	-160	-41.01	-40	Pass
NVNT	ax80	5690	Ant3	80	-39.55	-25	Pass
NVNT	ax80	5690	Ant3	160	-41.33	-40	Pass
NVNT	n20	5500	Ant1	-20	-27.71	-25	Pass
NVNT	n20	5500	Ant1	-40	-47.06	-40	Pass
NVNT	n20	5500	Ant1	20	-26.29	-25	Pass
NVNT	n20	5500	Ant1	40	-46.83	-40	Pass
NVNT	n20	5500	Ant2	-20	-26.91	-25	Pass
NVNT	n20	5500	Ant2	-40	-46.9	-40	Pass
NVNT	n20	5500	Ant2	20	-25.95	-25	Pass
NVNT	n20	5500	Ant2	40	-46.81	-40	Pass
NVNT	n20	5500	Ant3	-20	-27.26	-25	Pass
NVNT	n20	5500	Ant3	-40	-46.6	-40	Pass
NVNT	n20	5500	Ant3	20	-25.72	-25	Pass
NVNT	n20	5500	Ant3	40	-46.41	-40	Pass
NVNT	n20	5580	Ant1	-20	-30.67	-25	Pass
NVNT	n20	5580	Ant1	-40	-46.12	-40	Pass
NVNT	n20	5580	Ant1	20	-31.56	-25	Pass
NVNT	n20	5580	Ant1	40	-46.08	-40	Pass
NVNT	n20	5580	Ant2	-20	-30.92	-25	Pass
NVNT	n20	5580	Ant2	-40	-46.49	-40	Pass
NVNT	n20	5580	Ant2	20	-32.02	-25	Pass
NVNT	n20	5580	Ant2	40	-46.41	-40	Pass
NVNT	n20	5580	Ant3	-20	-30.74	-25	Pass
NVNT	n20	5580	Ant3	-40	-46.18	-40	Pass
NVNT	n20	5580	Ant3	20	-32.27	-25	Pass
NVNT	n20	5580	Ant3	40	-46.12	-40	Pass
NVNT	n20	5720	Ant1	-20	-30.83	-25	Pass
NVNT	n20	5720	Ant1	-40	-46.05	-40	Pass
NVNT	n20	5720	Ant1	20	-31.76	-25	Pass
NVNT	n20	5720	Ant1	40	-45.63	-40	Pass
NVNT	n20	5720	Ant2	-20	-30.76	-25	Pass
NVNT	n20	5720	Ant2	-40	-46.42	-40	Pass
NVNT	n20	5720	Ant2	20	-32.14	-25	Pass
NVNT	n20	5720	Ant2	40	-46.22	-40	Pass
NVNT	n20	5720	Ant3	-20	-30.64	-25	Pass
NVNT	n20	5720	Ant3	-40	-46.57	-40	Pass
NVNT	n20	5720	Ant3	20	-32.44	-25	Pass
NVNT	n20	5720	Ant3	40	-46.05	-40	Pass
NVNT	n40	5510	Ant1	-40	-30.85	-25	Pass
NVNT	n40	5510	Ant1	-80	-44.16	-40	Pass
NVNT	n40	5510	Ant1	40	-28.1	-25	Pass


NVNT	n40	5510	Ant1	80	-43.97	-40	Pass
NVNT	n40	5510	Ant2	-40	-30.71	-25	Pass
NVNT	n40	5510	Ant2	-80	-44.21	-40	Pass
NVNT	n40	5510	Ant2	40	-28.03	-25	Pass
NVNT	n40	5510	Ant2	80	-43.92	-40	Pass
NVNT	n40	5510	Ant3	-40	-30.92	-25	Pass
NVNT	n40	5510	Ant3	-80	-43.87	-40	Pass
NVNT	n40	5510	Ant3	40	-28.28	-25	Pass
NVNT	n40	5510	Ant3	80	-43.69	-40	Pass
NVNT	n40	5590	Ant1	-40	-37.66	-25	Pass
NVNT	n40	5590	Ant1	-80	-43.93	-40	Pass
NVNT	n40	5590	Ant1	40	-38.05	-25	Pass
NVNT	n40	5590	Ant1	80	-44.44	-40	Pass
NVNT	n40	5590	Ant2	-40	-37.41	-25	Pass
NVNT	n40	5590	Ant2	-80	-44.03	-40	Pass
NVNT	n40	5590	Ant2	40	-38.43	-25	Pass
NVNT	n40	5590	Ant2	80	-44.56	-40	Pass
NVNT	n40	5590	Ant3	-40	-37.02	-25	Pass
NVNT	n40	5590	Ant3	-80	-43.59	-40	Pass
NVNT	n40	5590	Ant3	40	-37.94	-25	Pass
NVNT	n40	5590	Ant3	80	-44.11	-40	Pass
NVNT	n40	5710	Ant1	-40	-37.41	-25	Pass
NVNT	n40	5710	Ant1	-80	-44.01	-40	Pass
NVNT	n40	5710	Ant1	40	-38.59	-25	Pass
NVNT	n40	5710	Ant1	80	-44.26	-40	Pass
NVNT	n40	5710	Ant2	-40	-37.72	-25	Pass
NVNT	n40	5710	Ant2	-80	-44.39	-40	Pass
NVNT	n40	5710	Ant2	40	-38.74	-25	Pass
NVNT	n40	5710	Ant2	80	-44.44	-40	Pass
NVNT	n40	5710	Ant3	-40	-38.61	-25	Pass
NVNT	n40	5710	Ant3	-80	-43.95	-40	Pass
NVNT	n40	5710	Ant3	40	-38.75	-25	Pass
NVNT	n40	5710	Ant3	80	-44.15	-40	Pass


Test Graphs



ACEP NVNT a 5500MHz Ant1







ACEP NVNT a 5580MHz Ant1

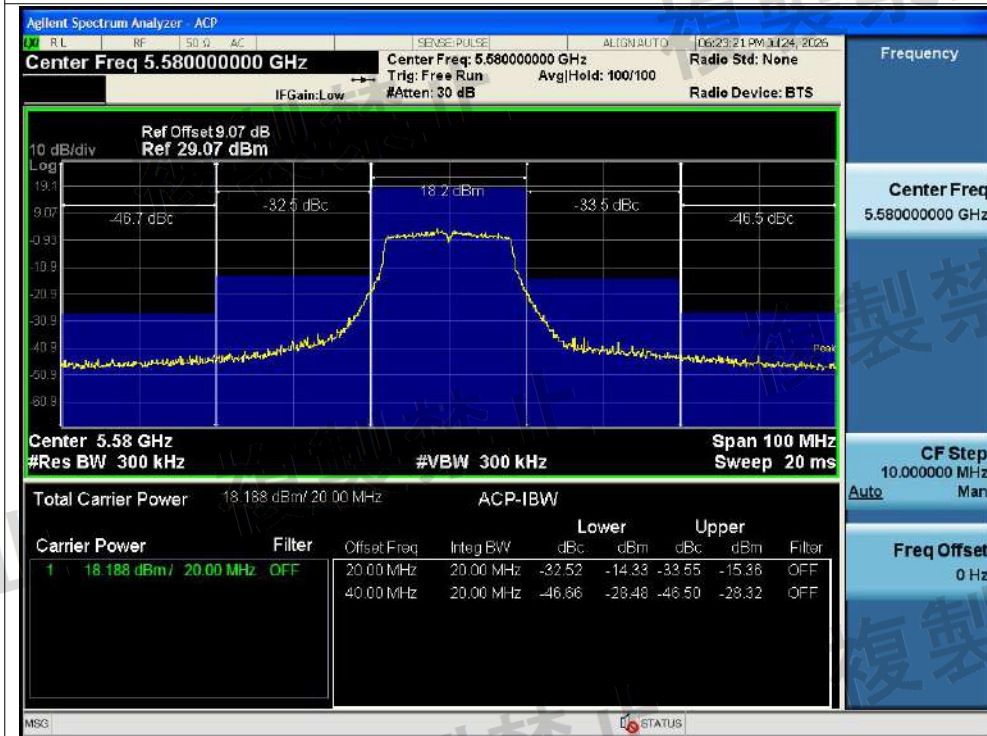



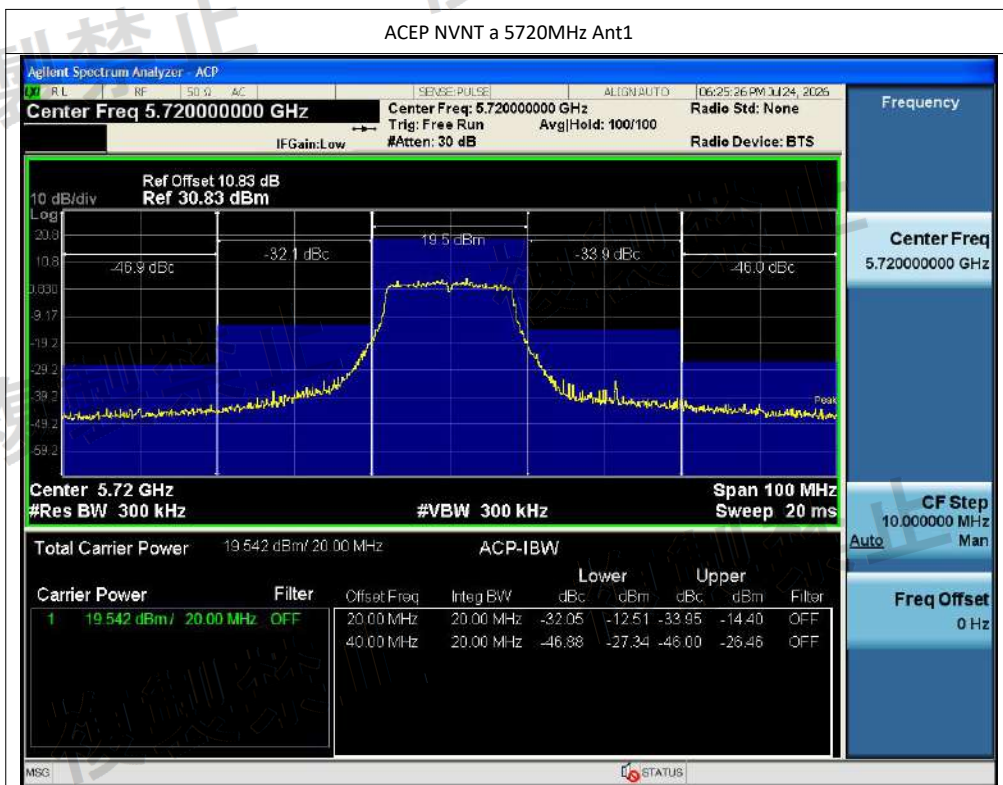


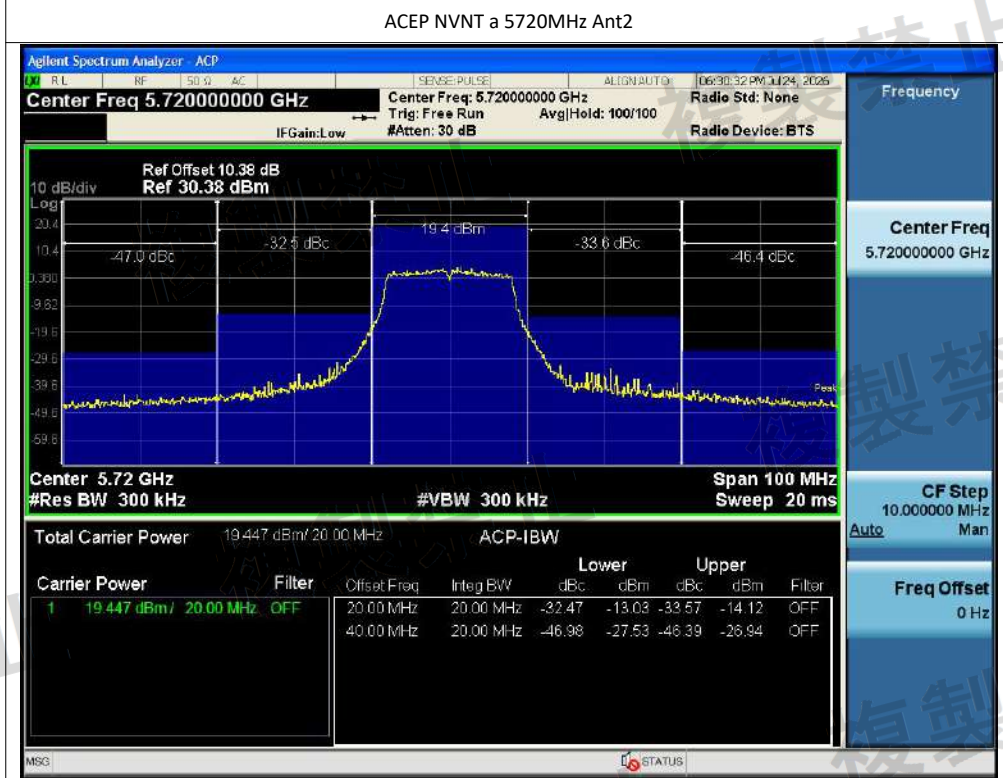
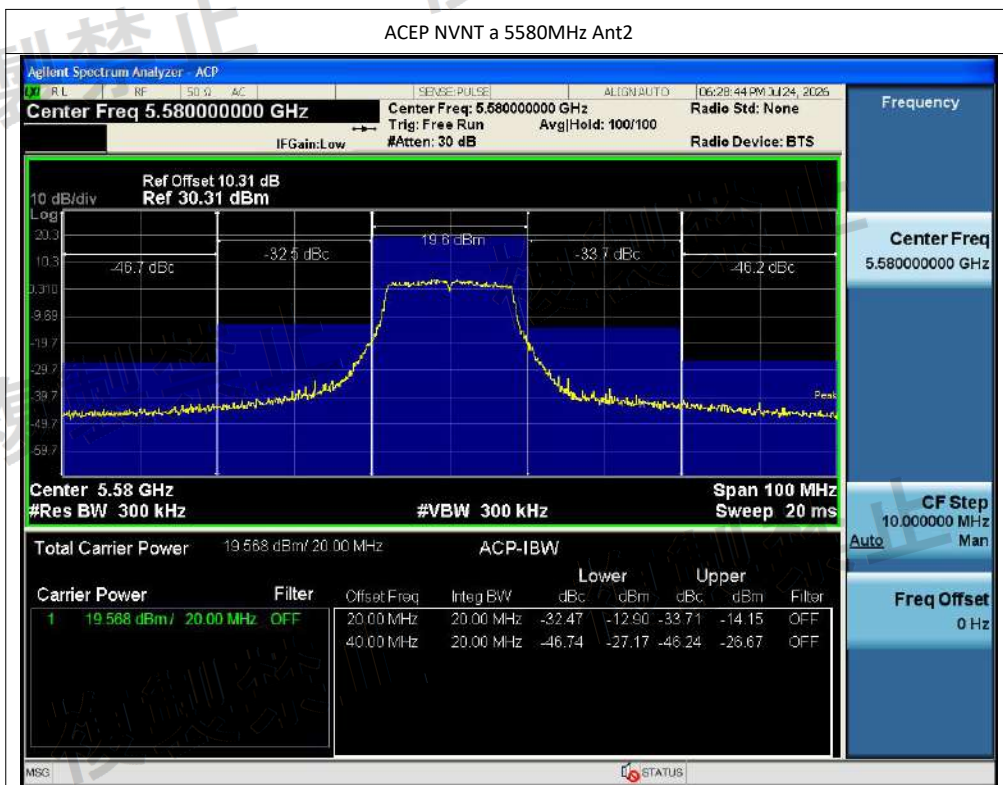


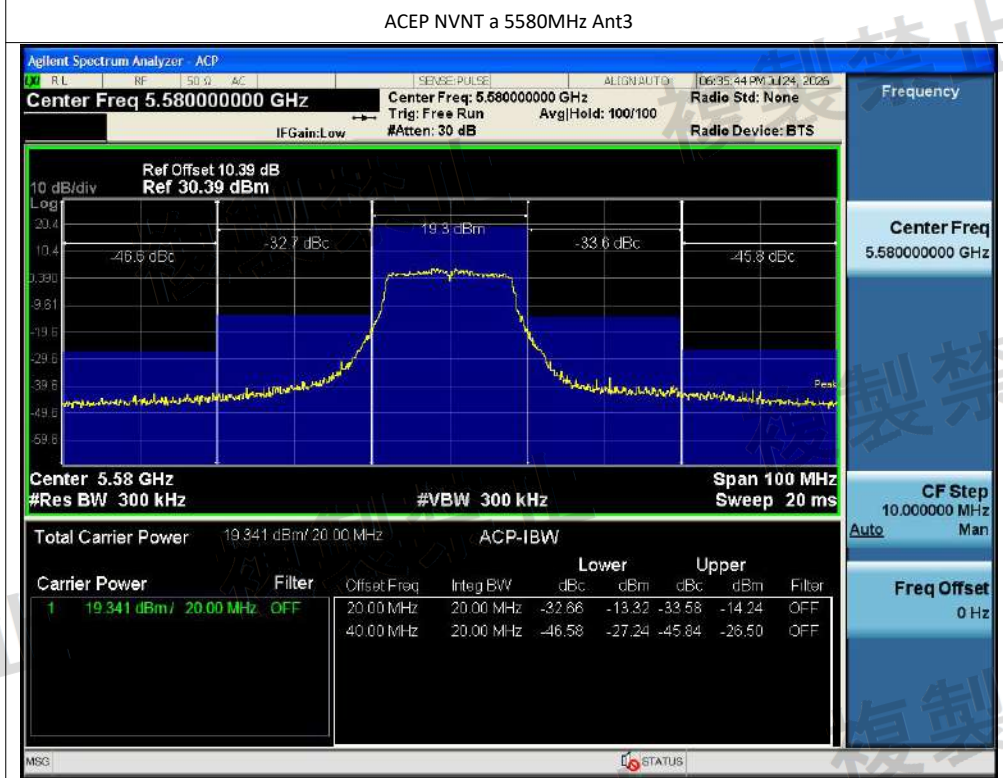
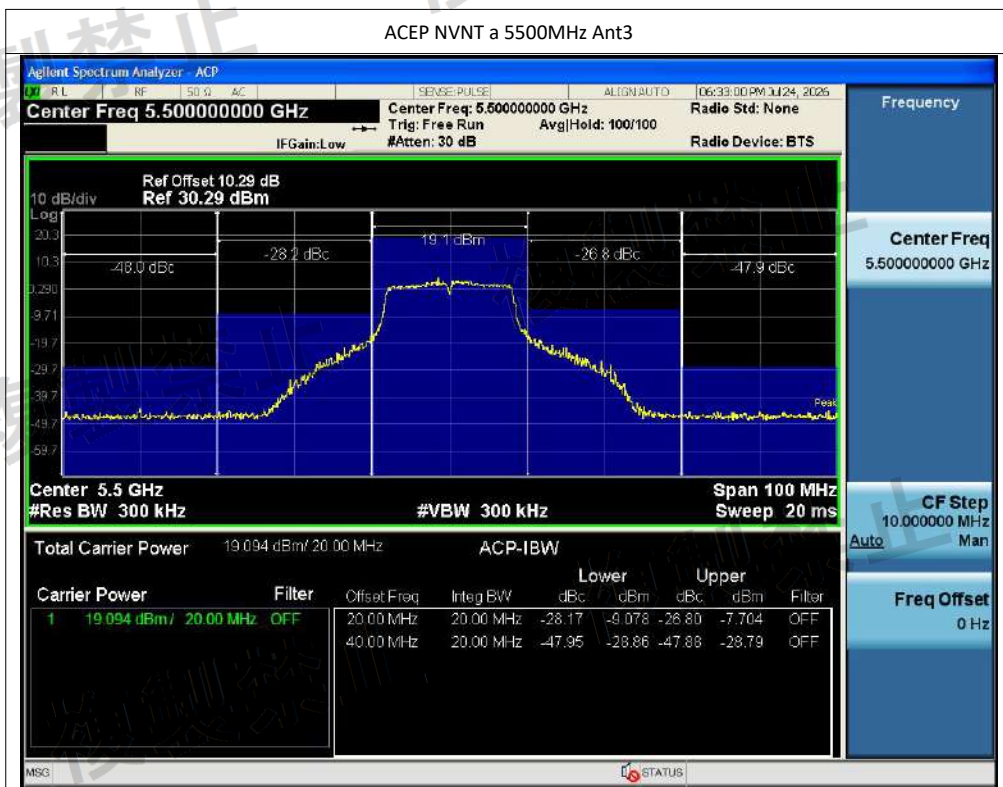


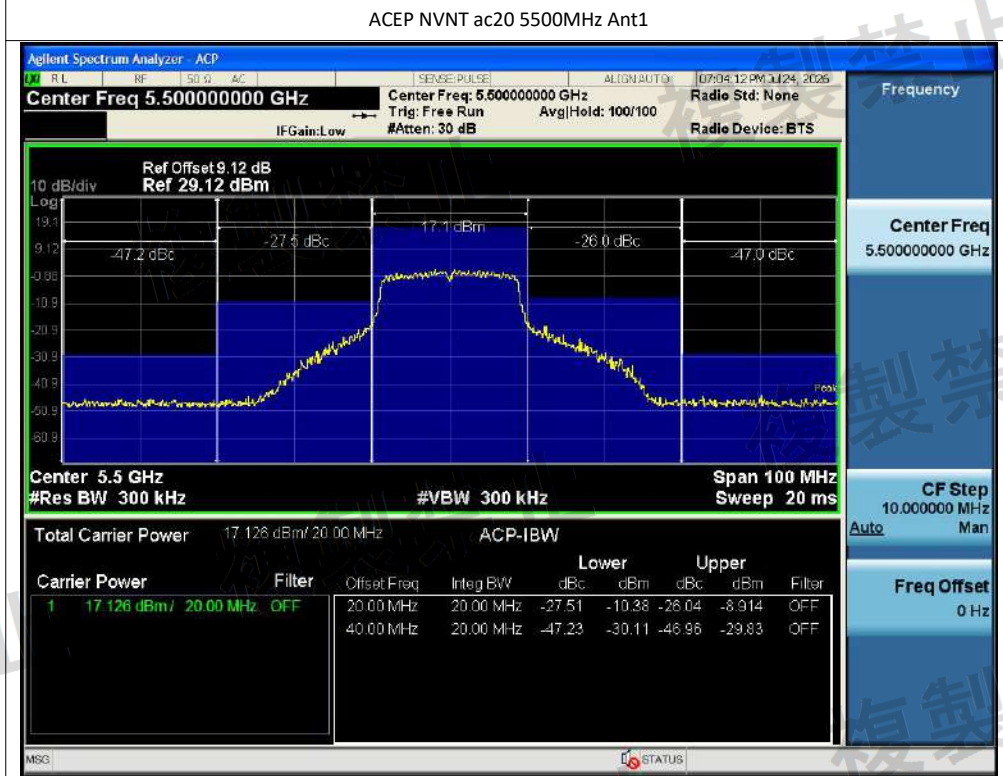
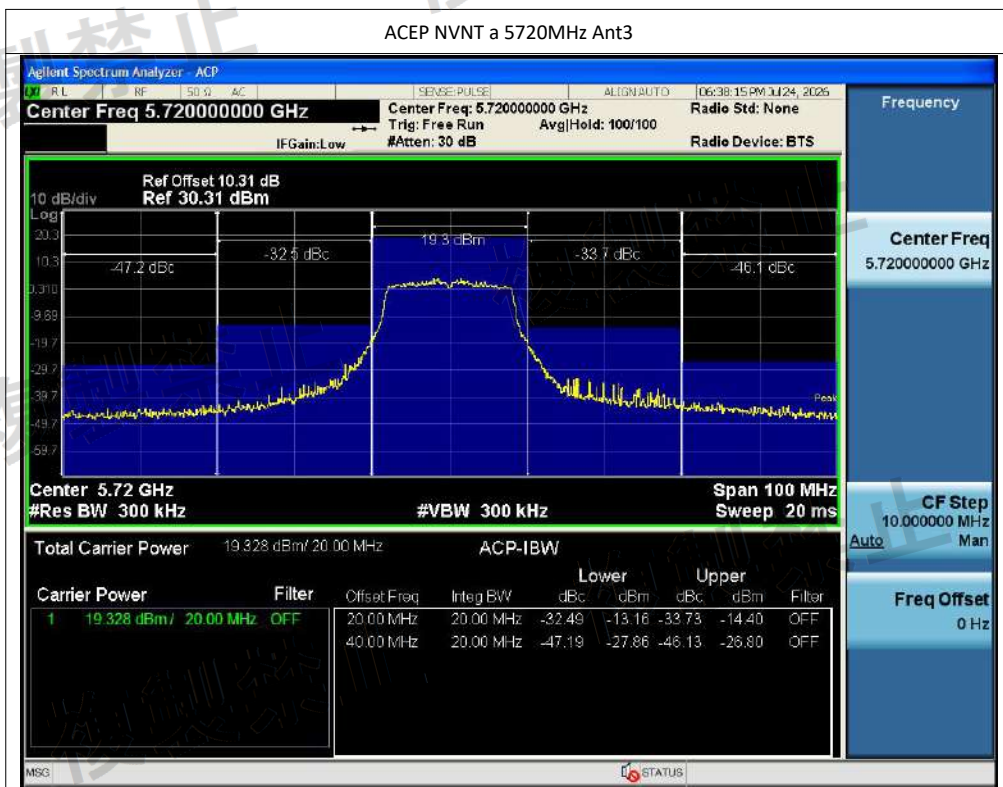



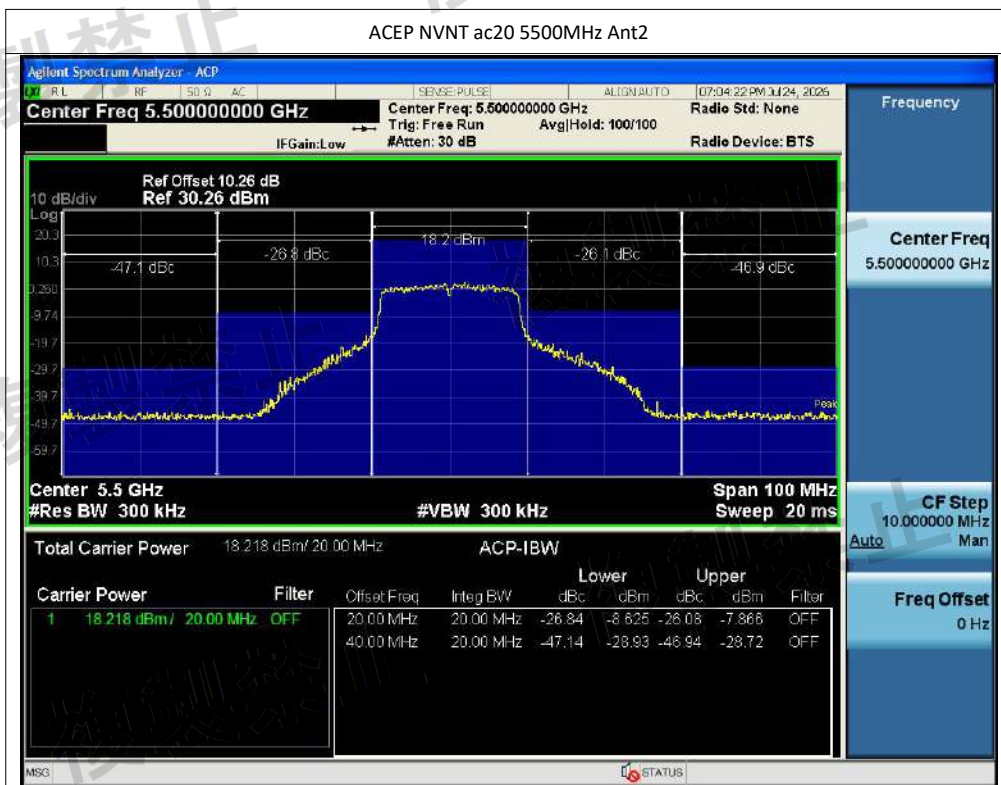


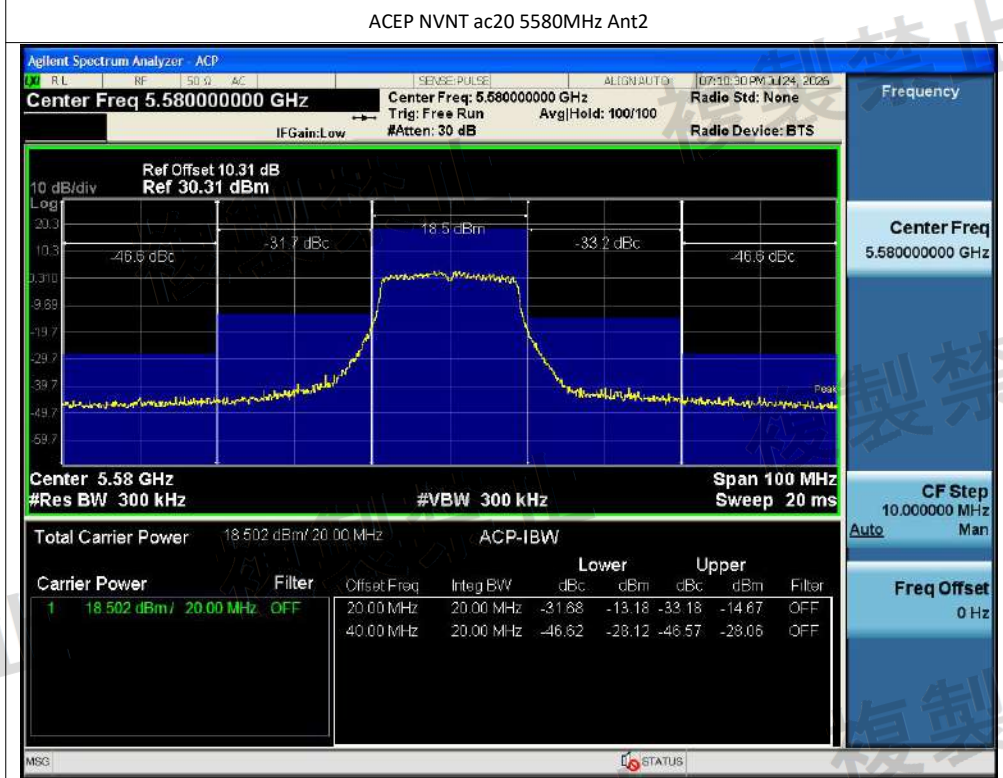
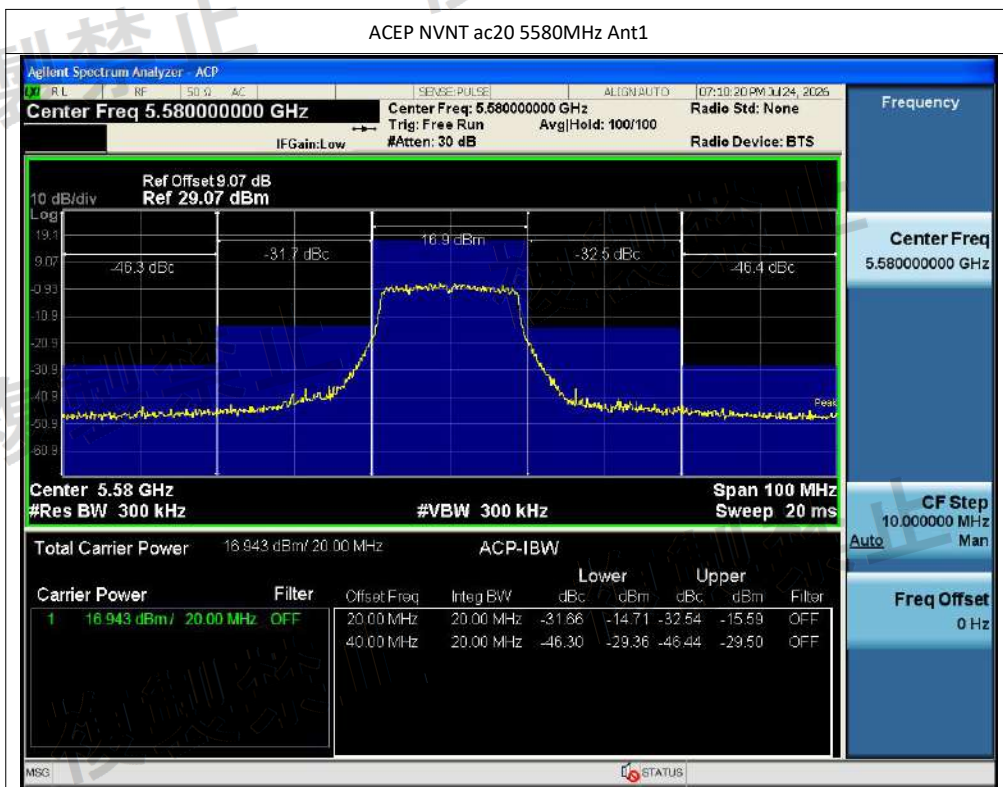


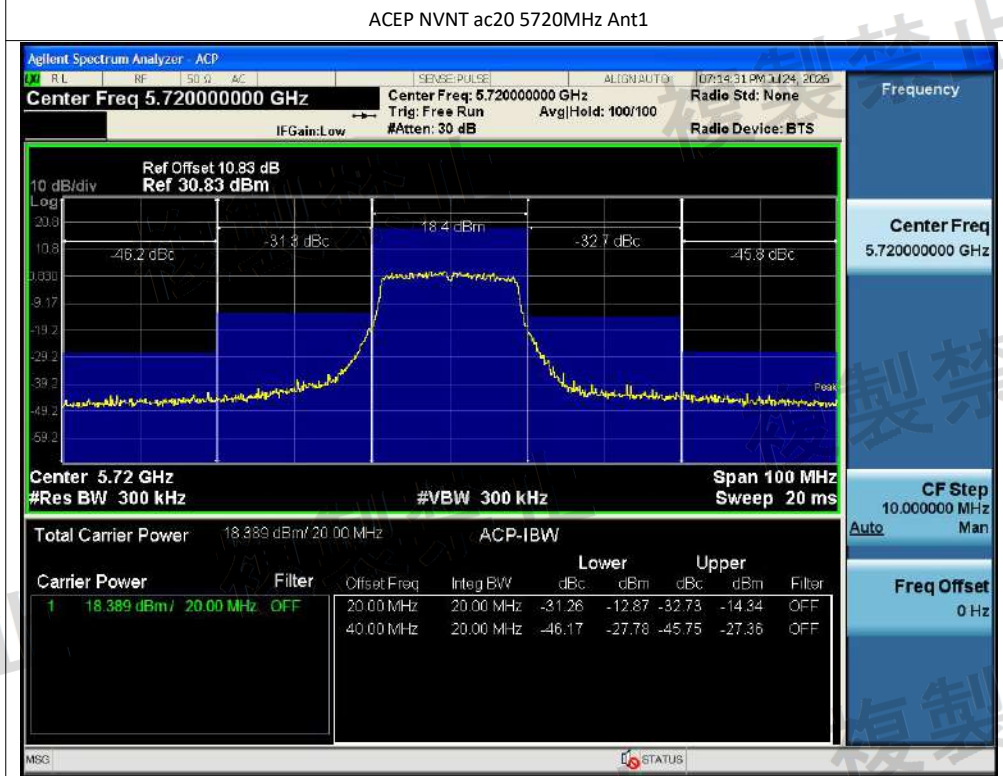
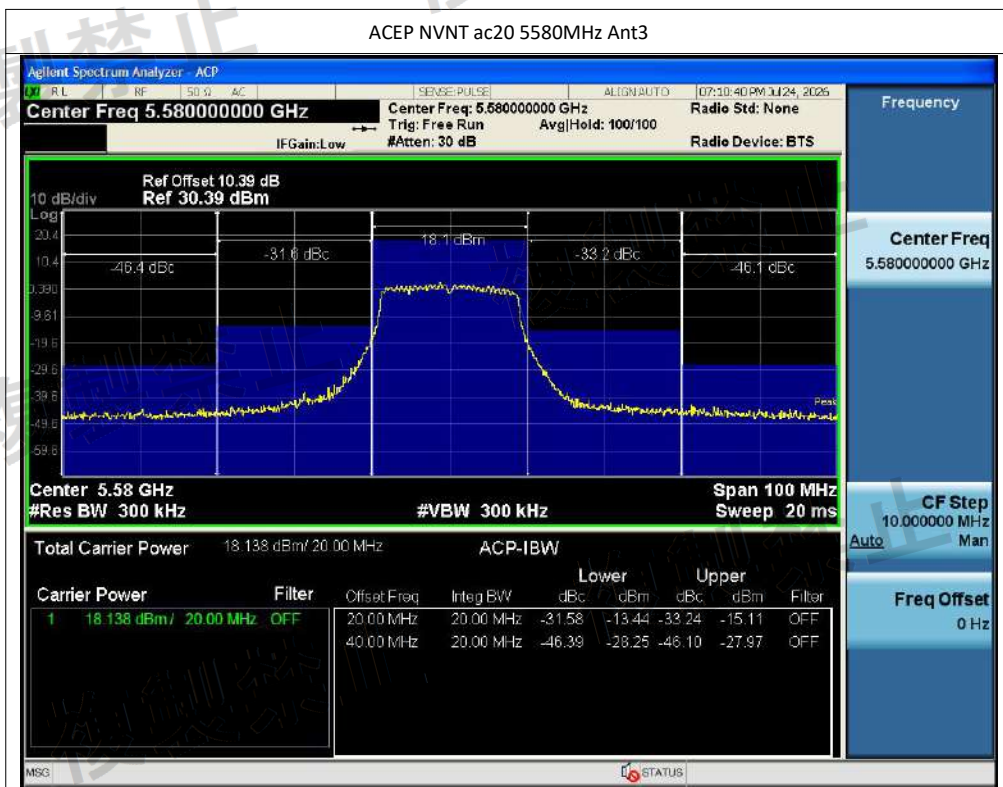


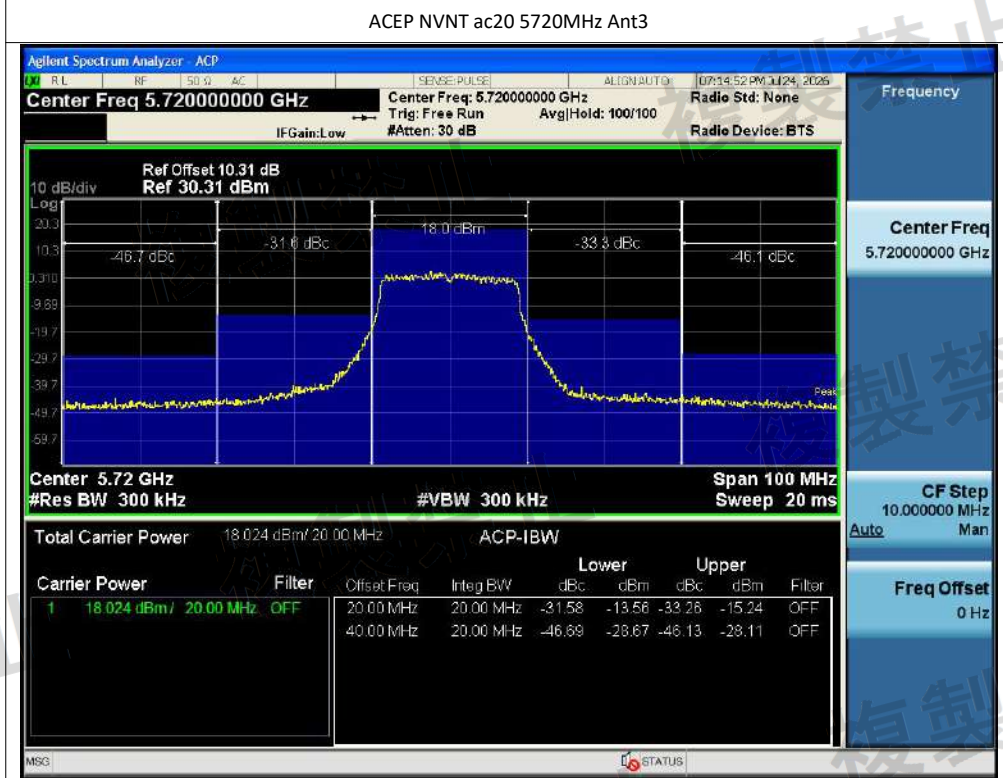
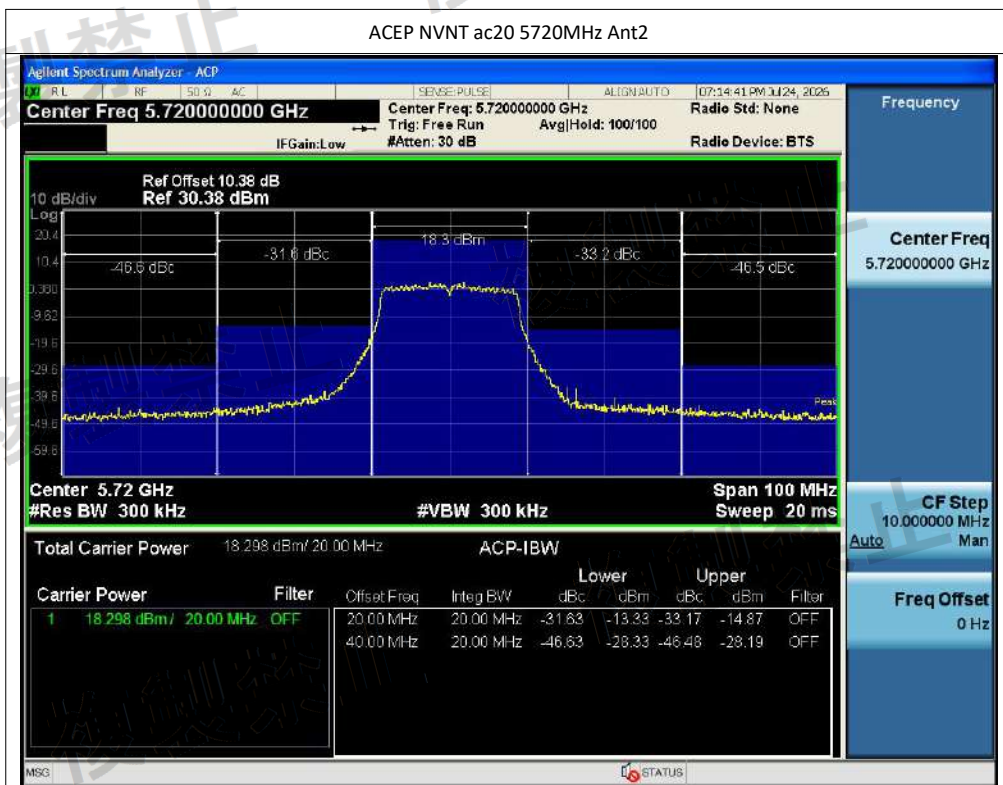


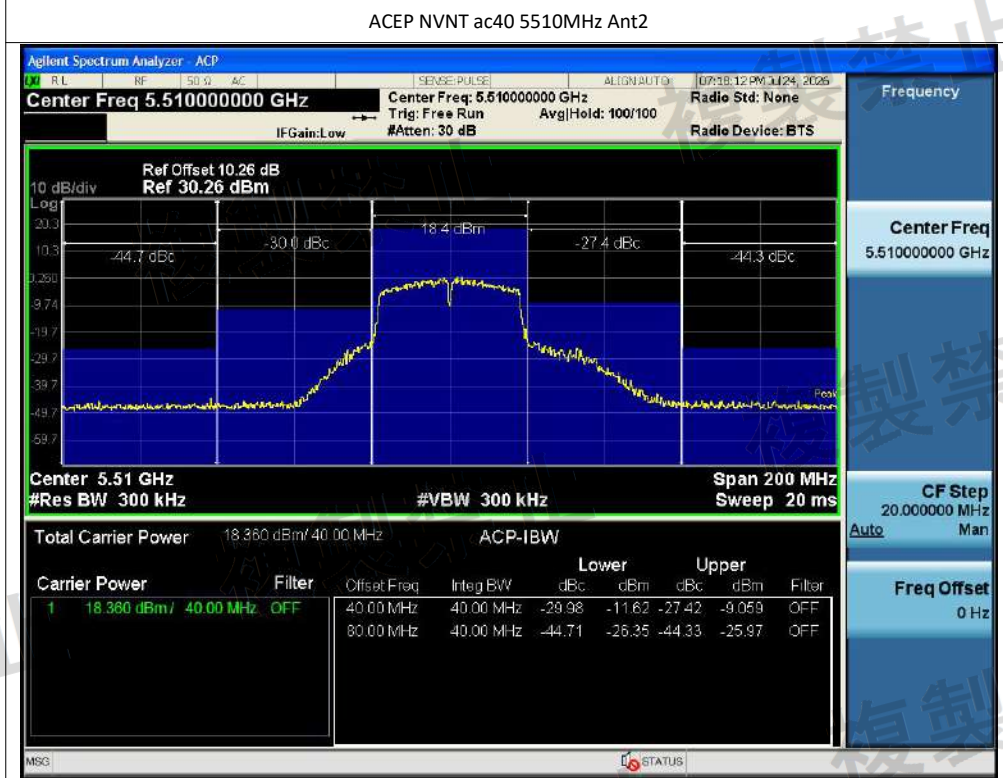
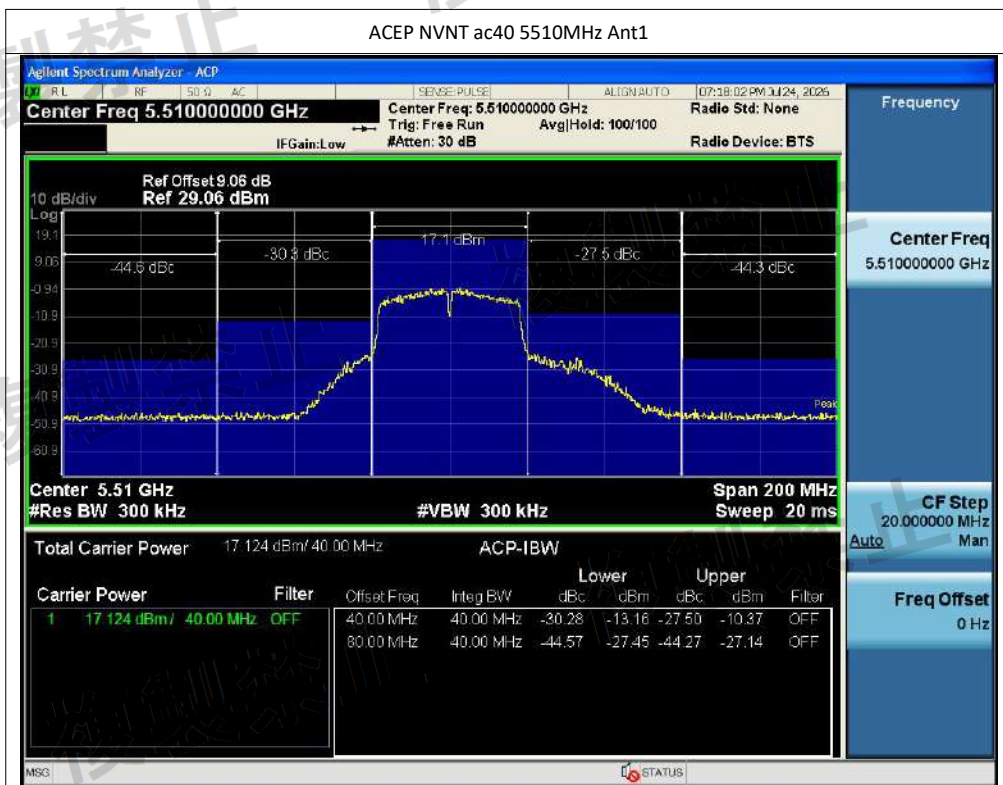


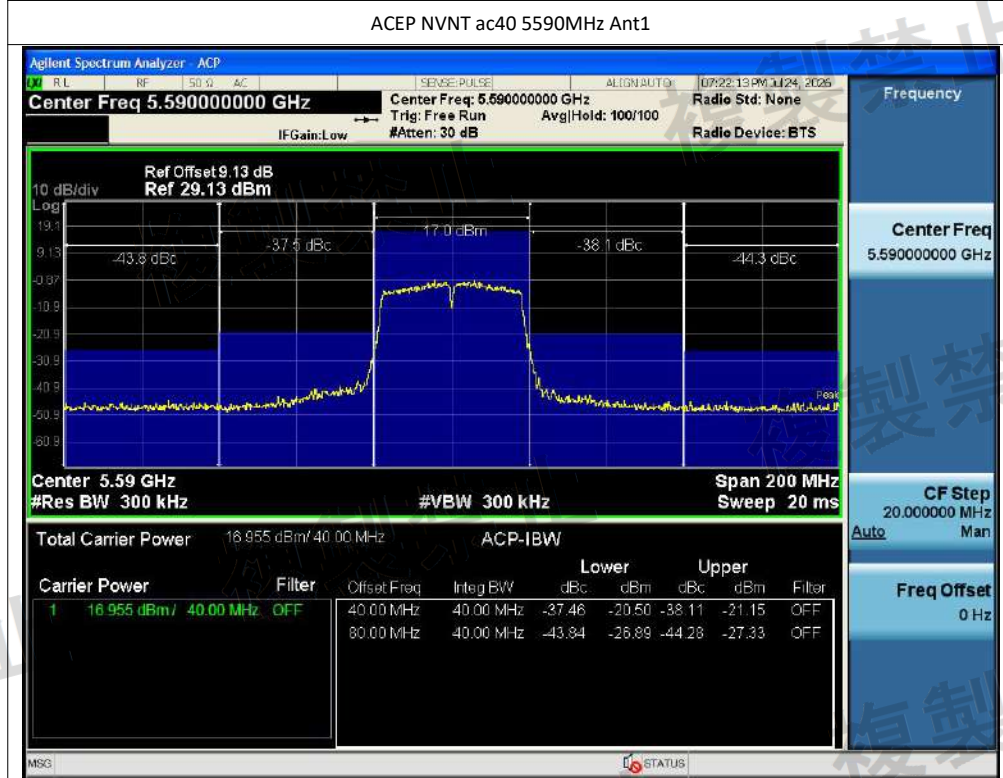
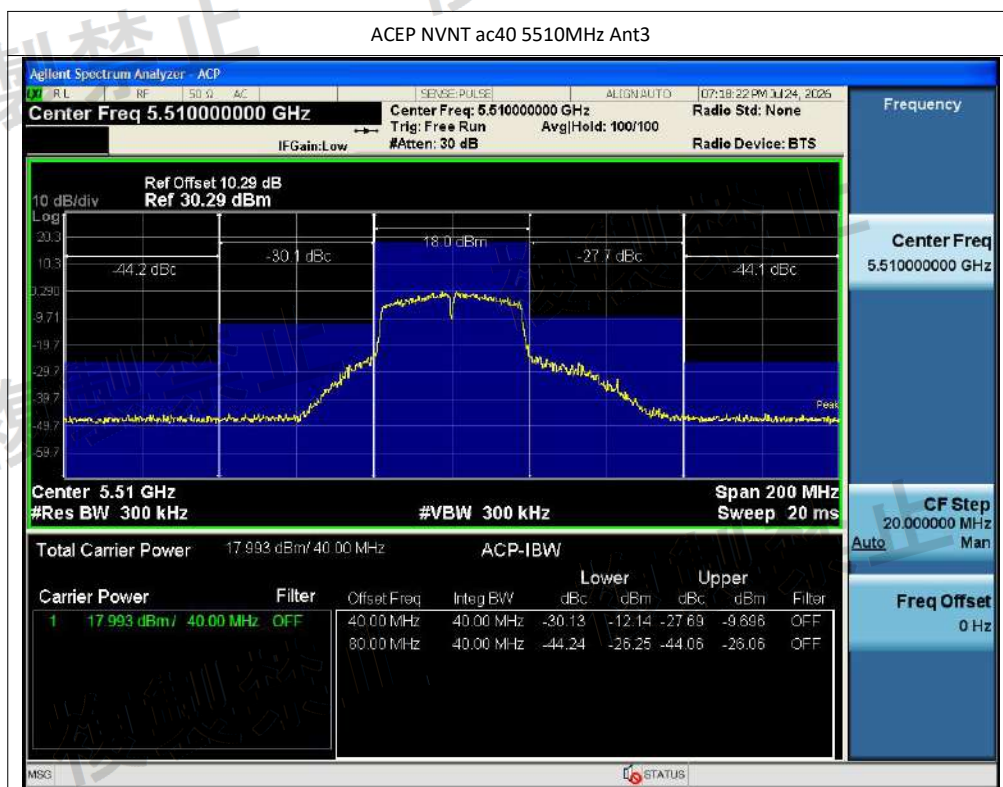


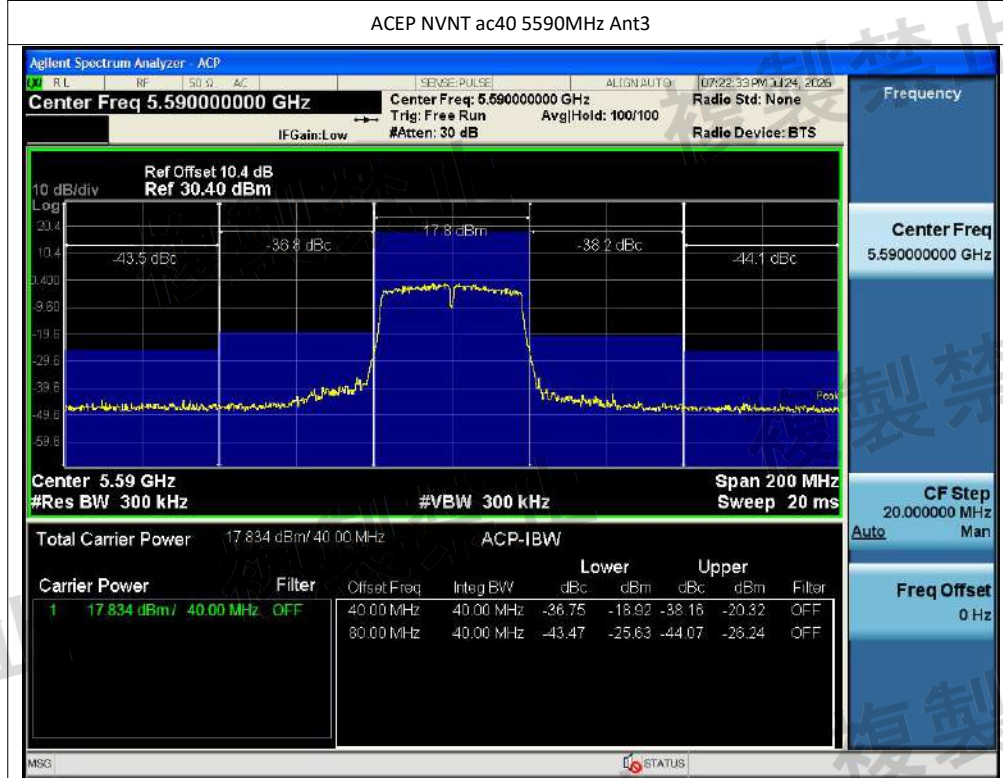
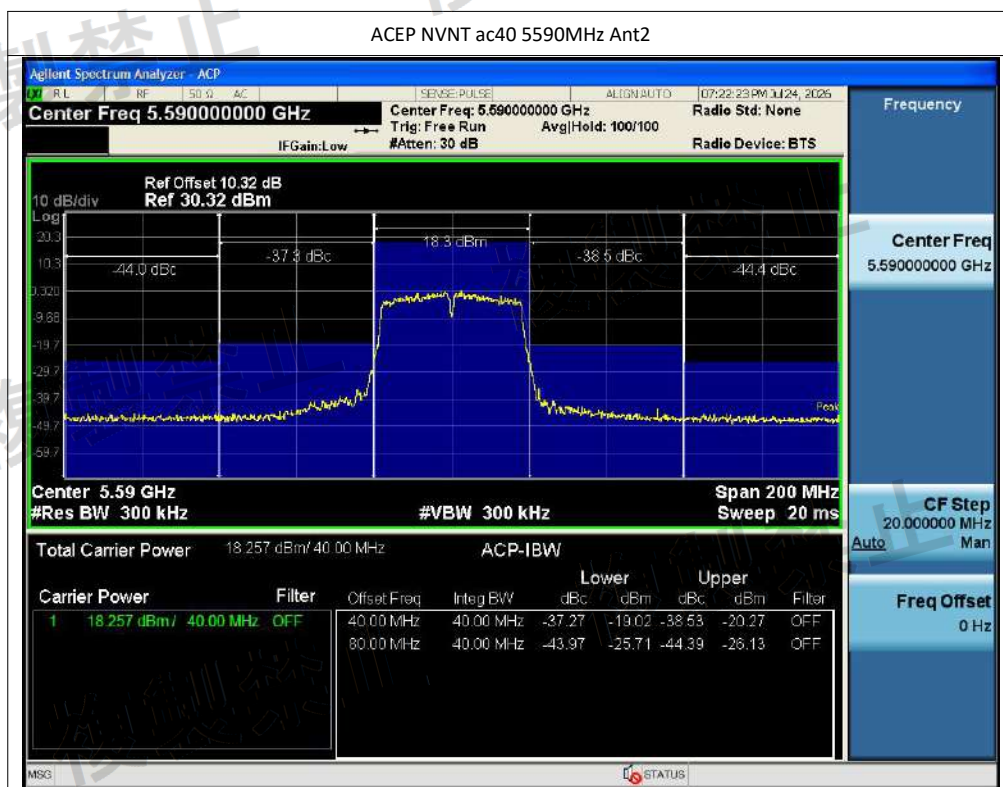


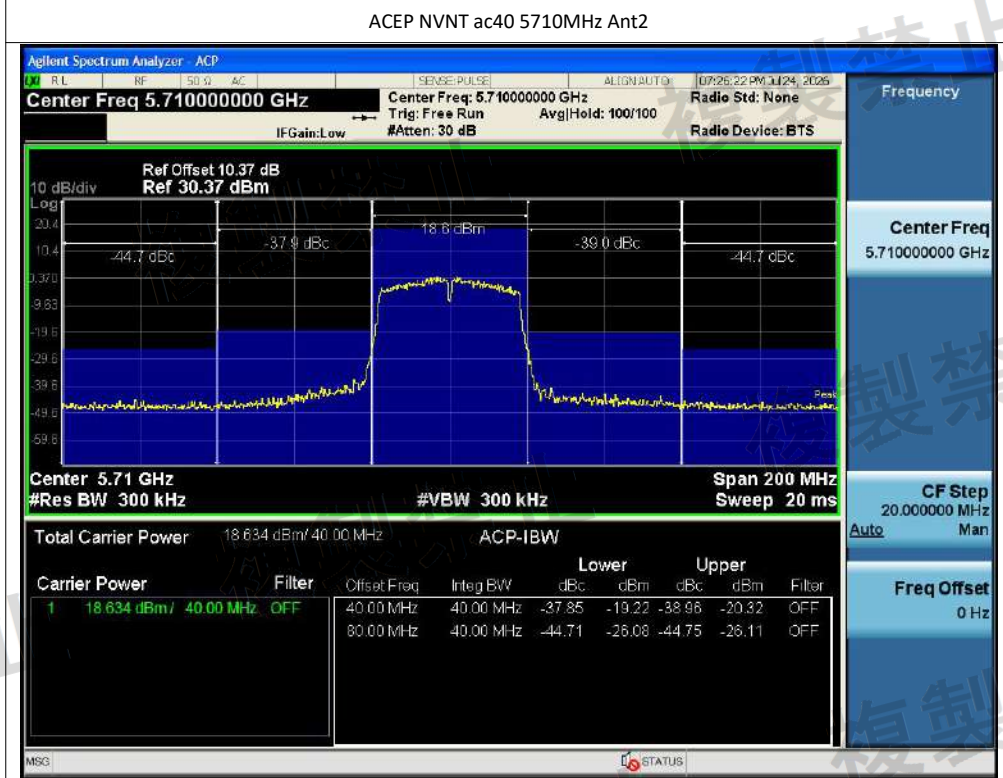
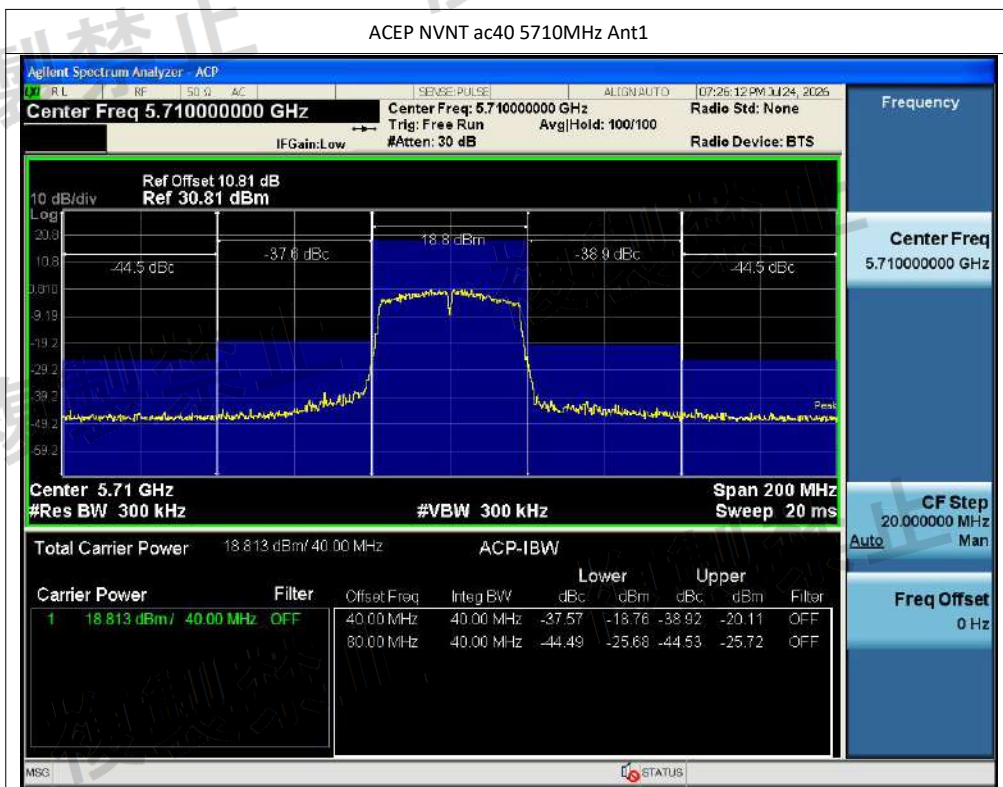


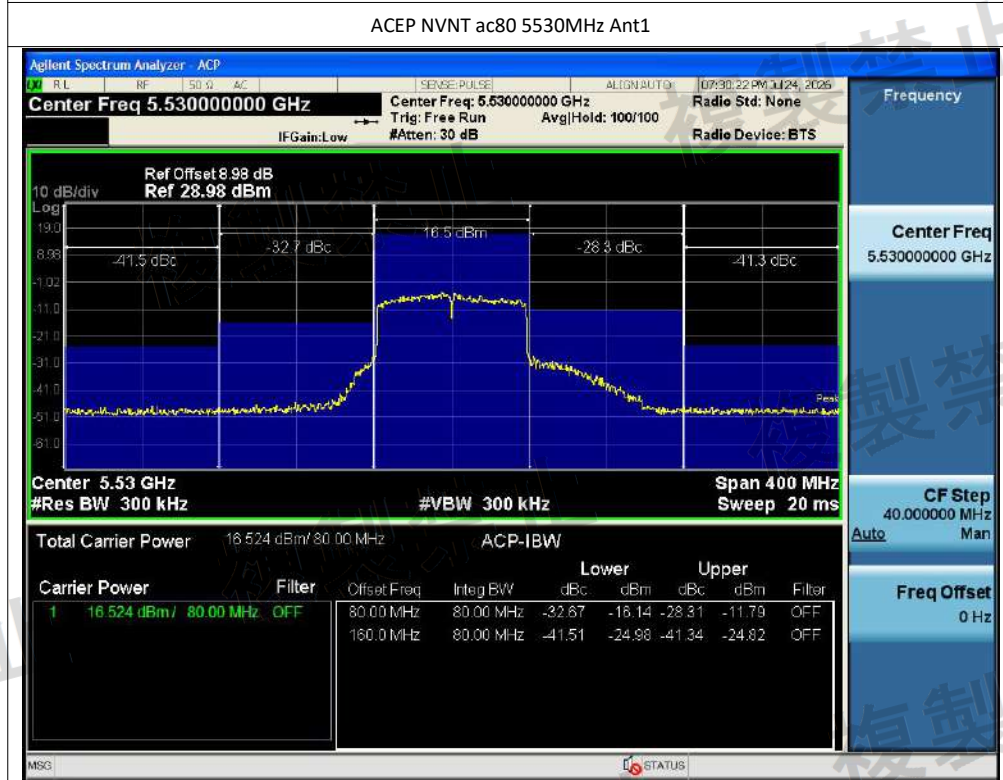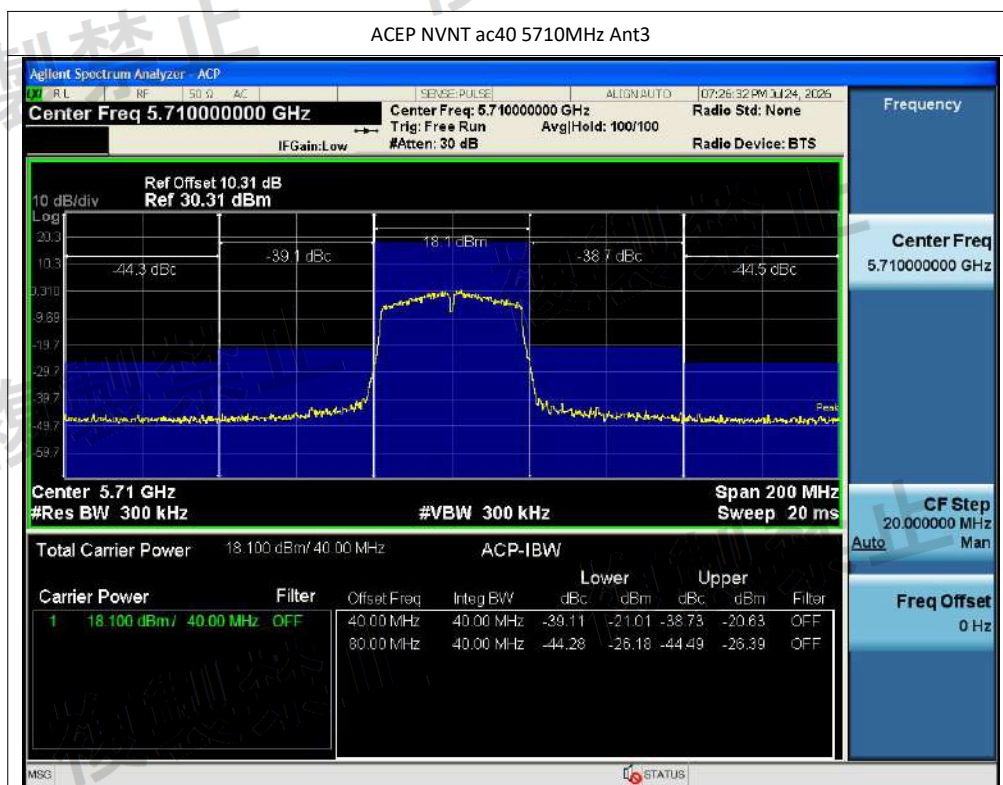


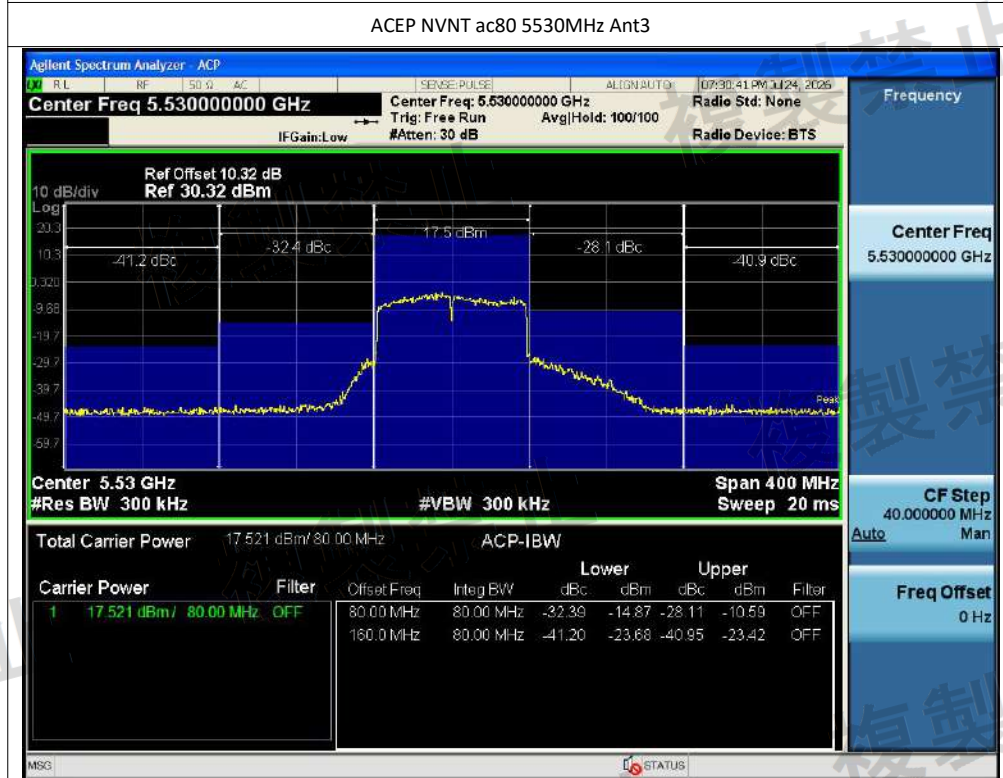
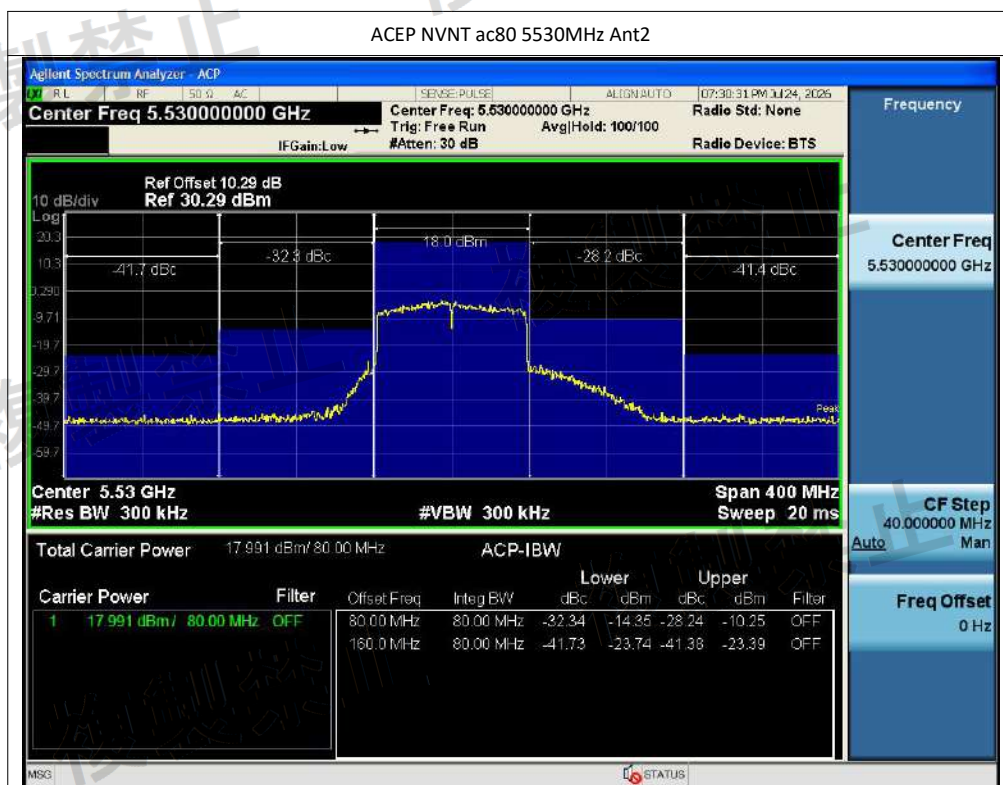


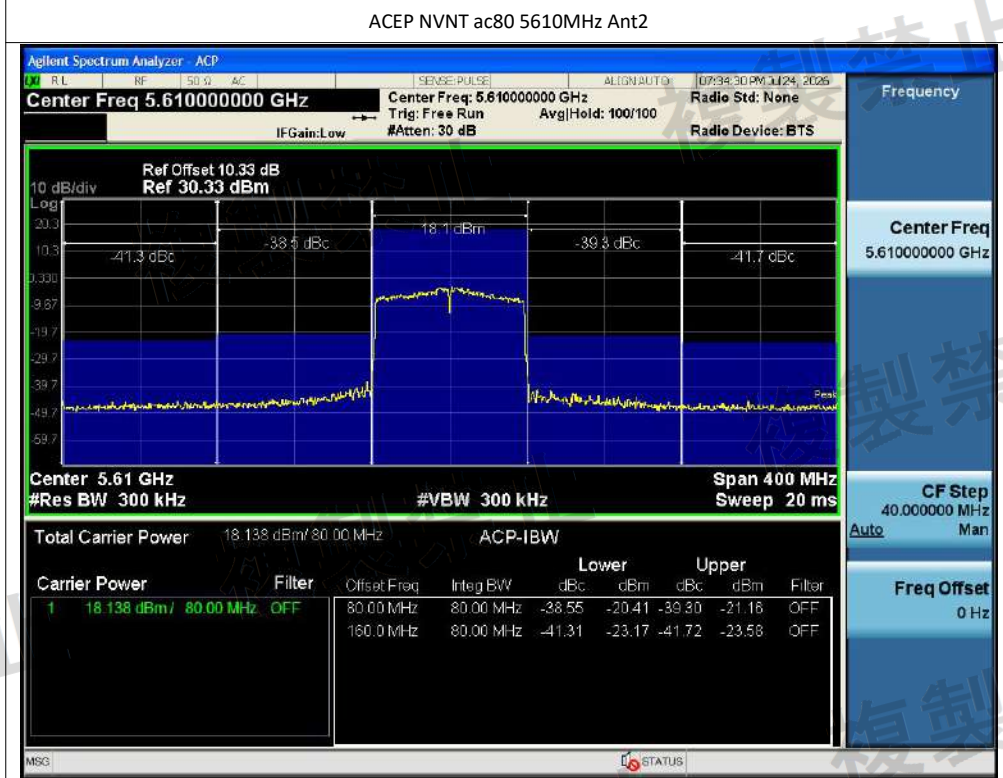
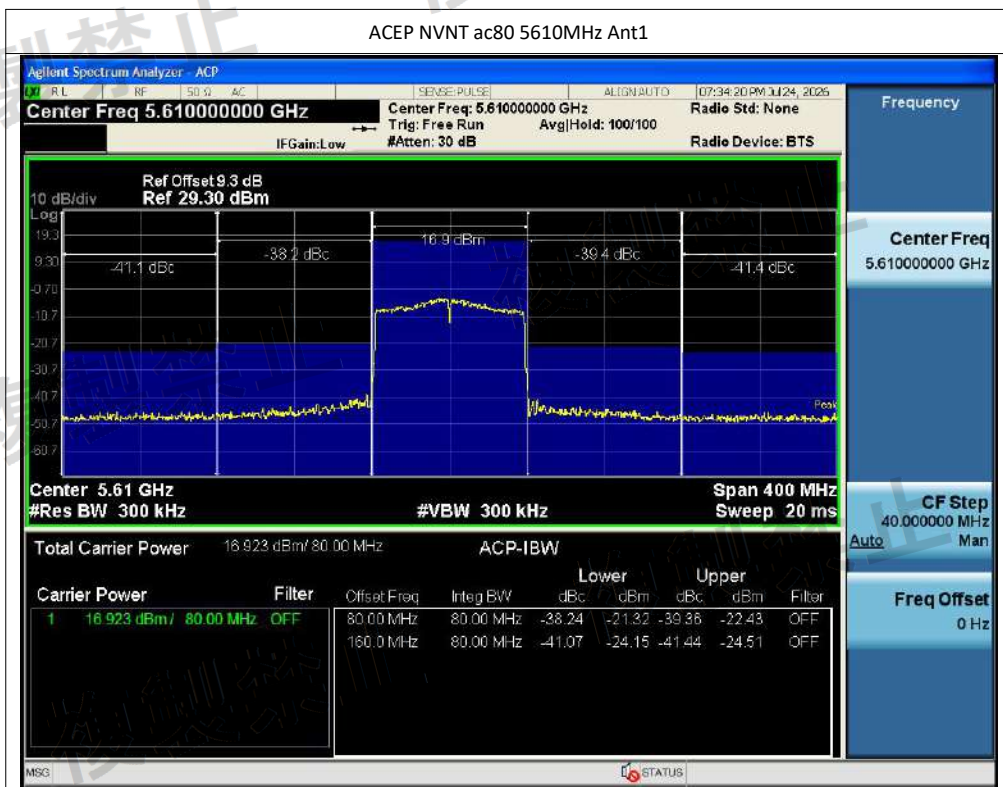


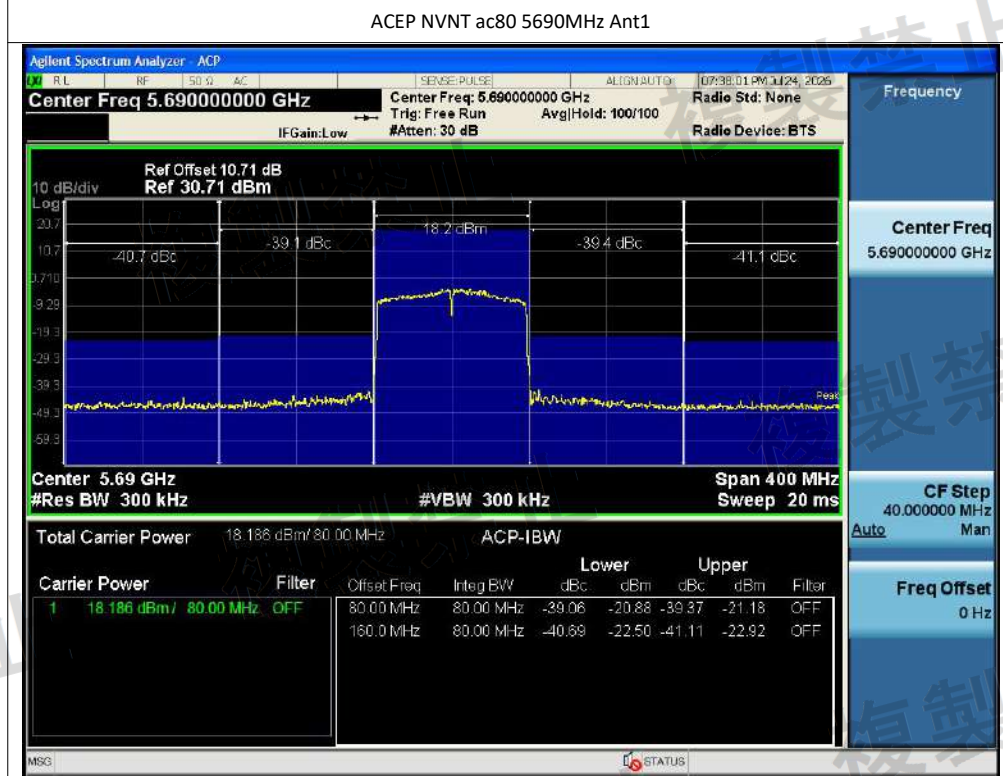
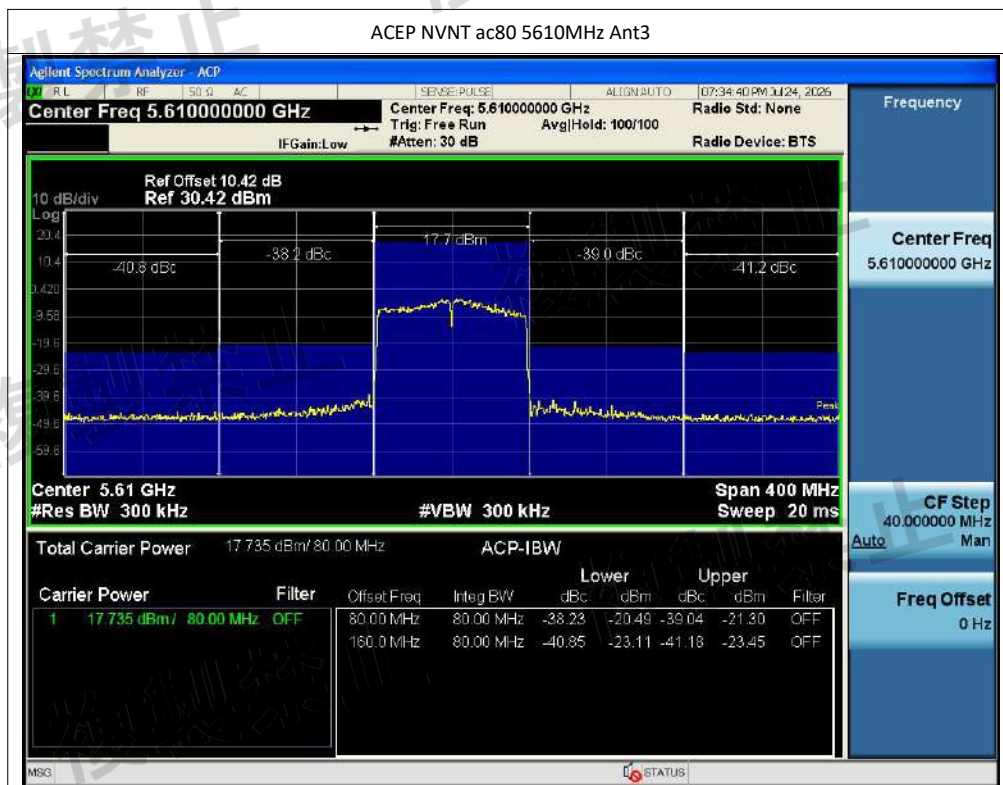


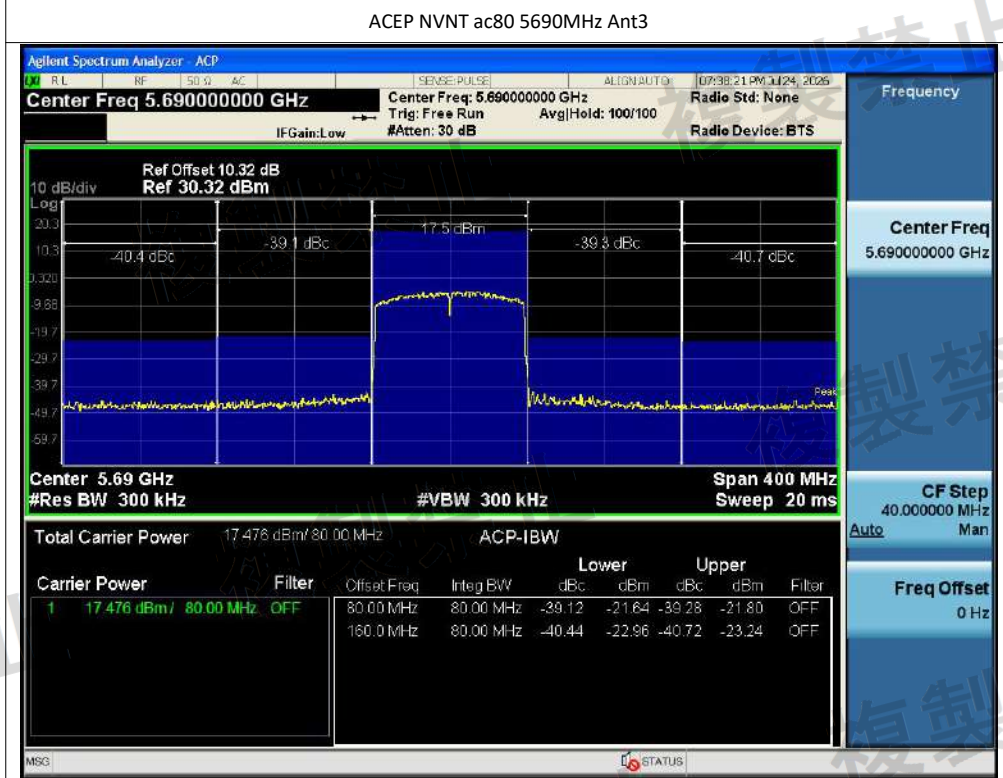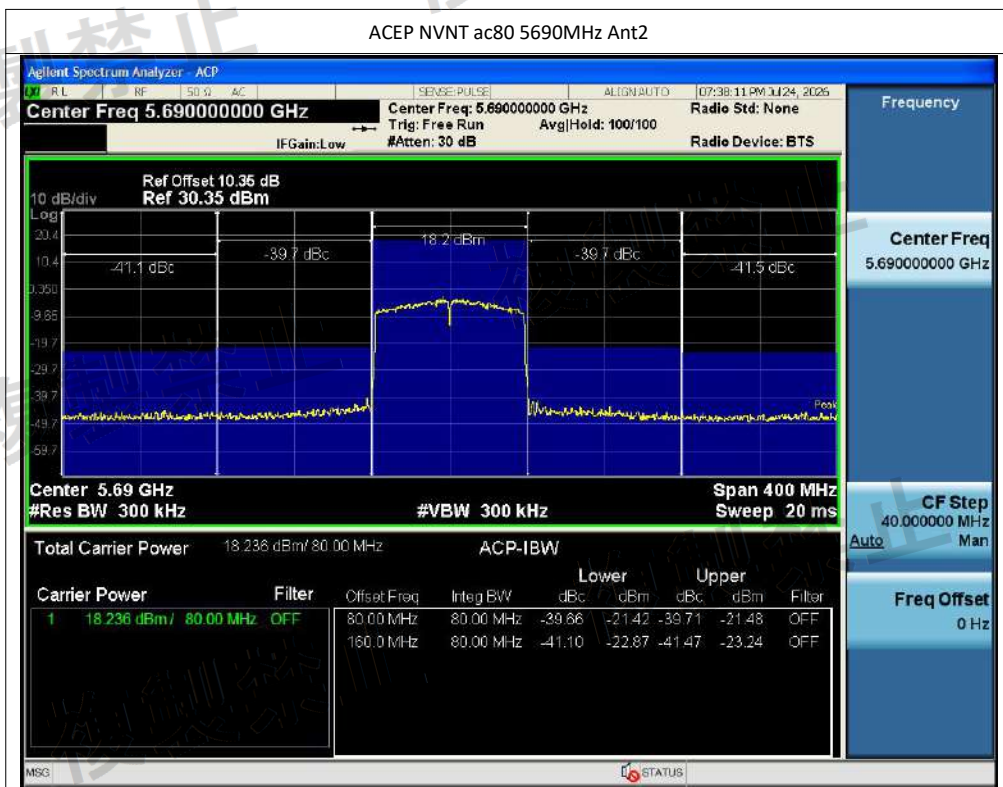


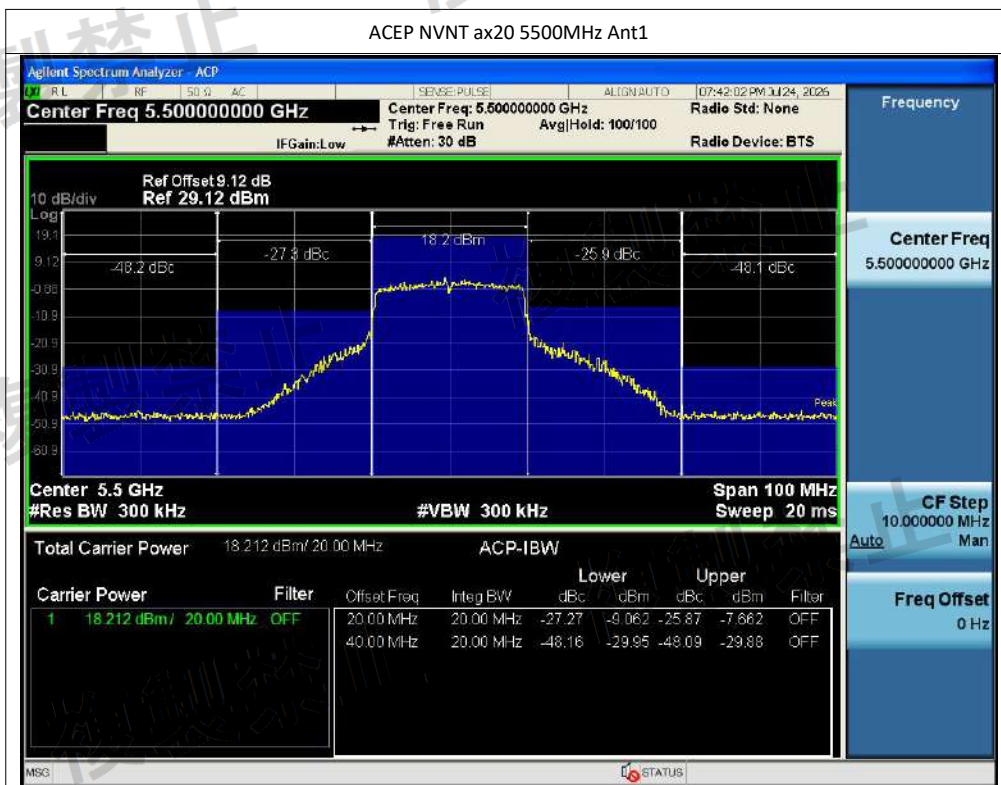


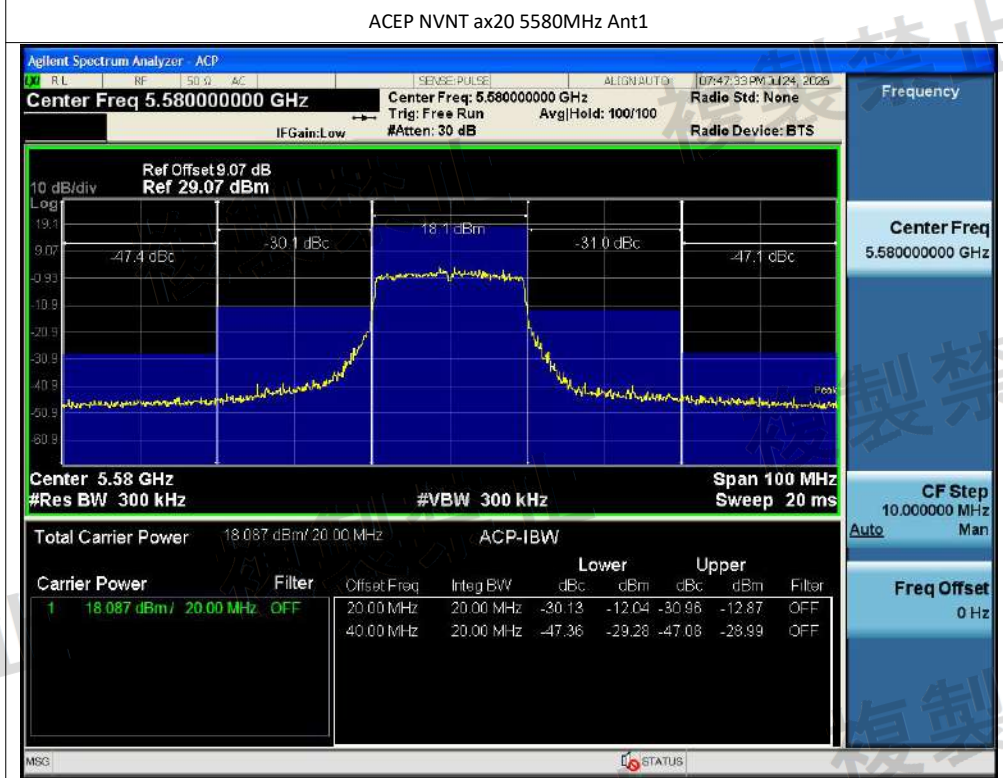
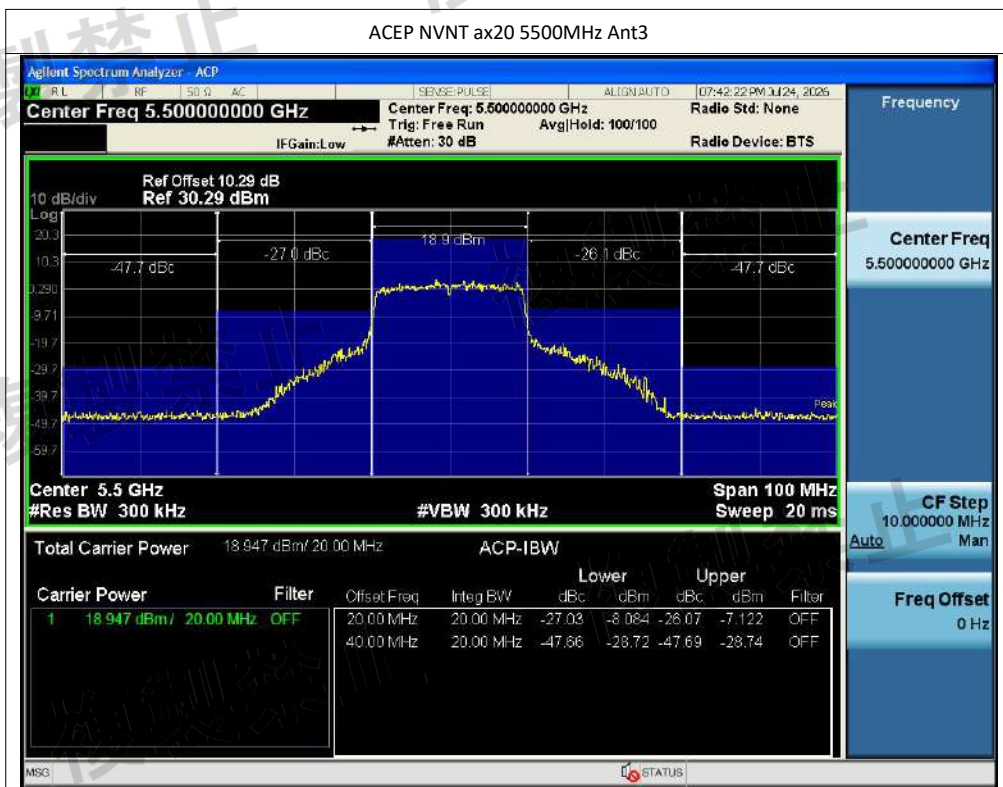


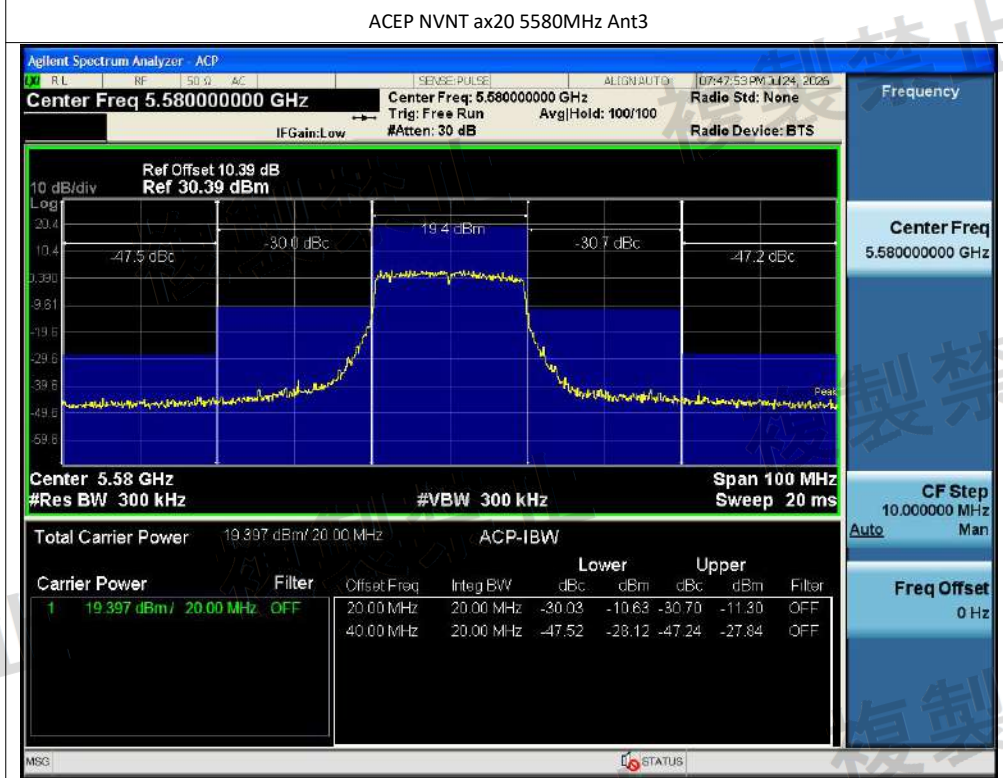
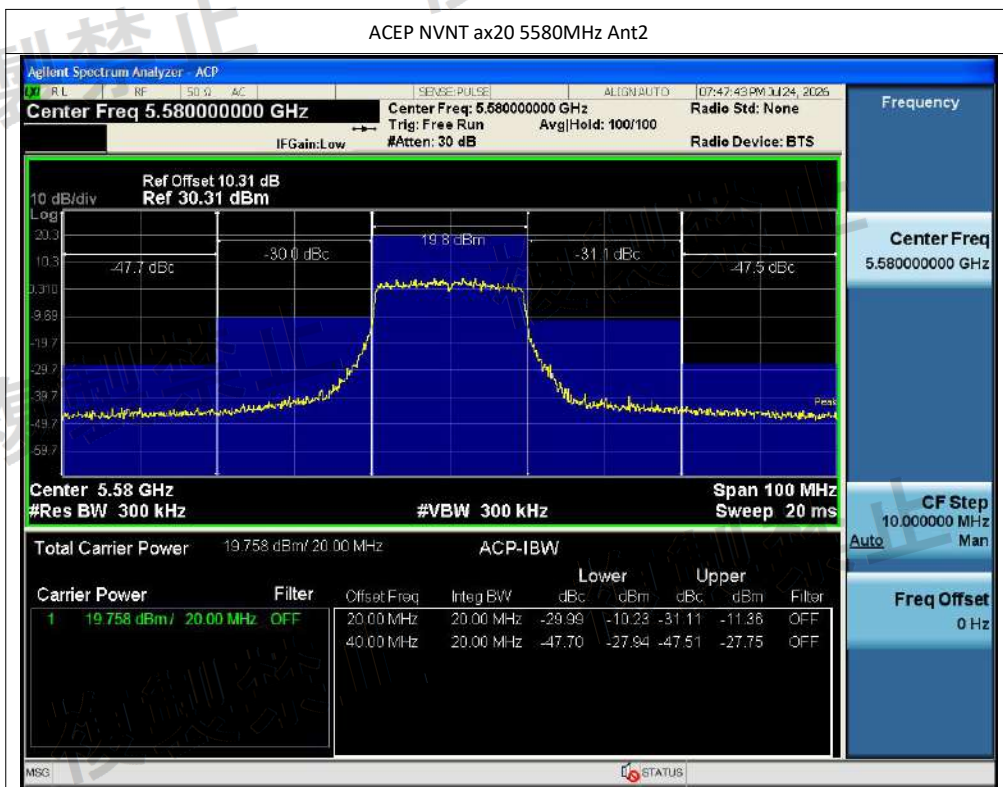


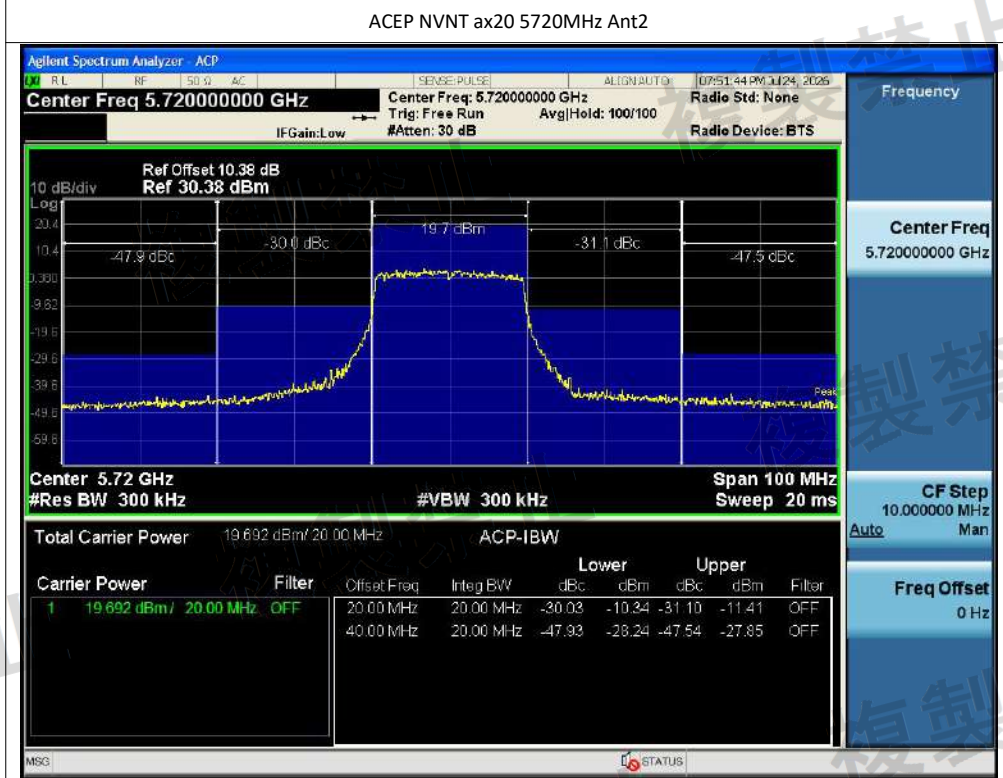
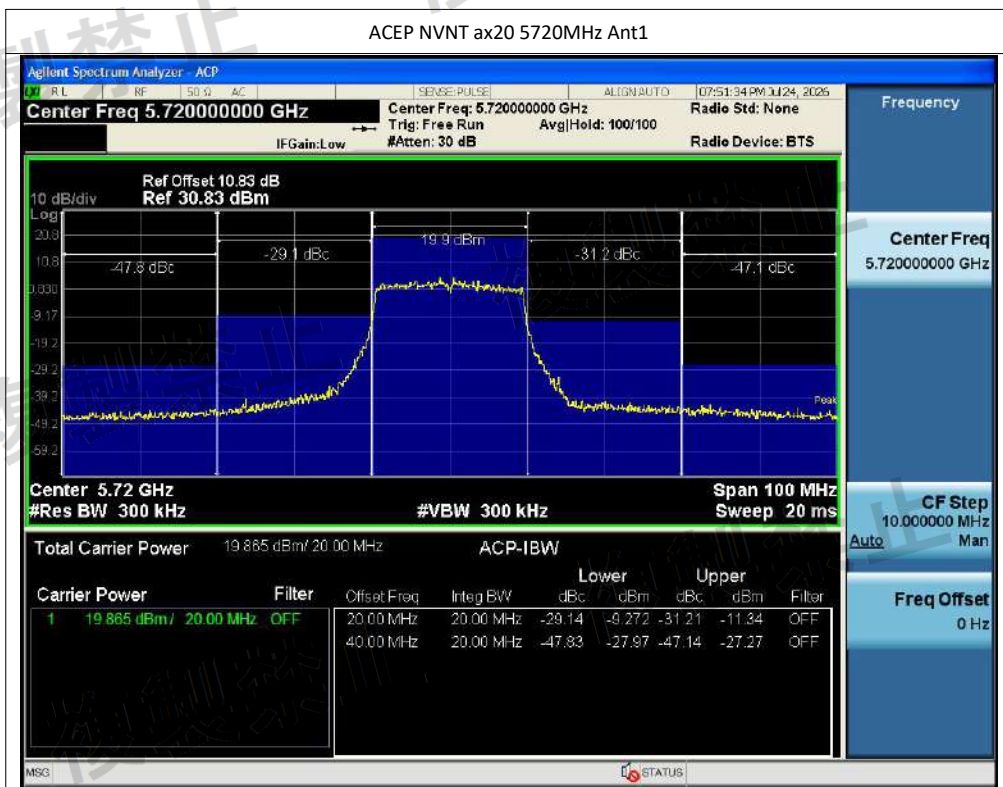



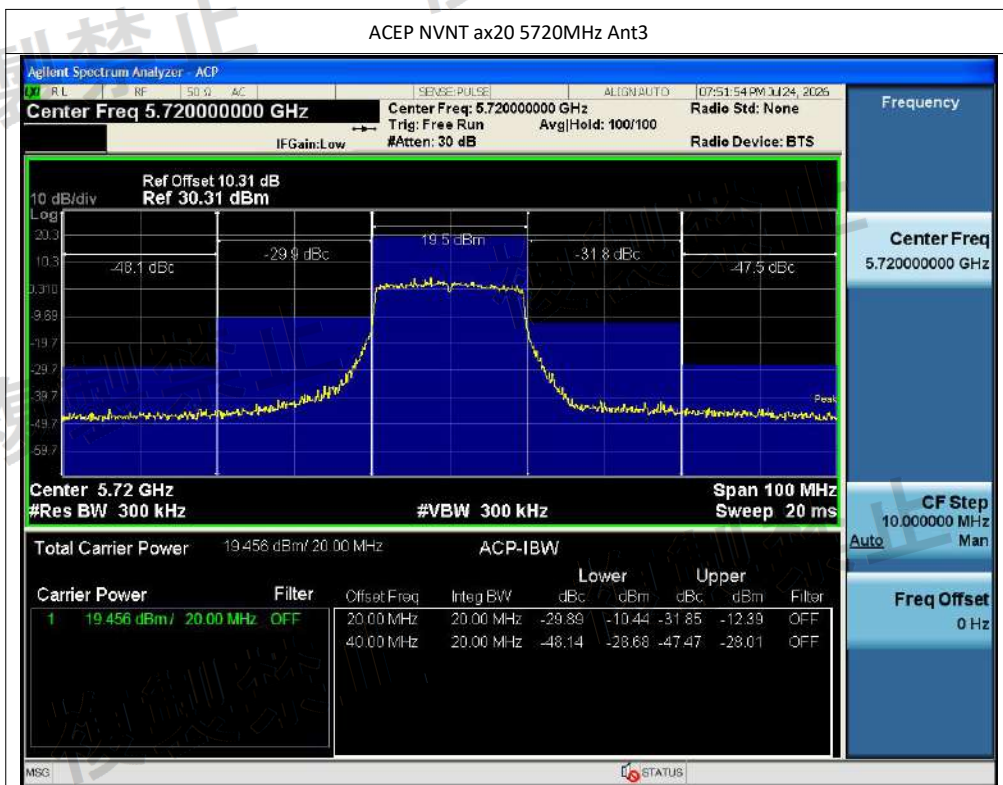



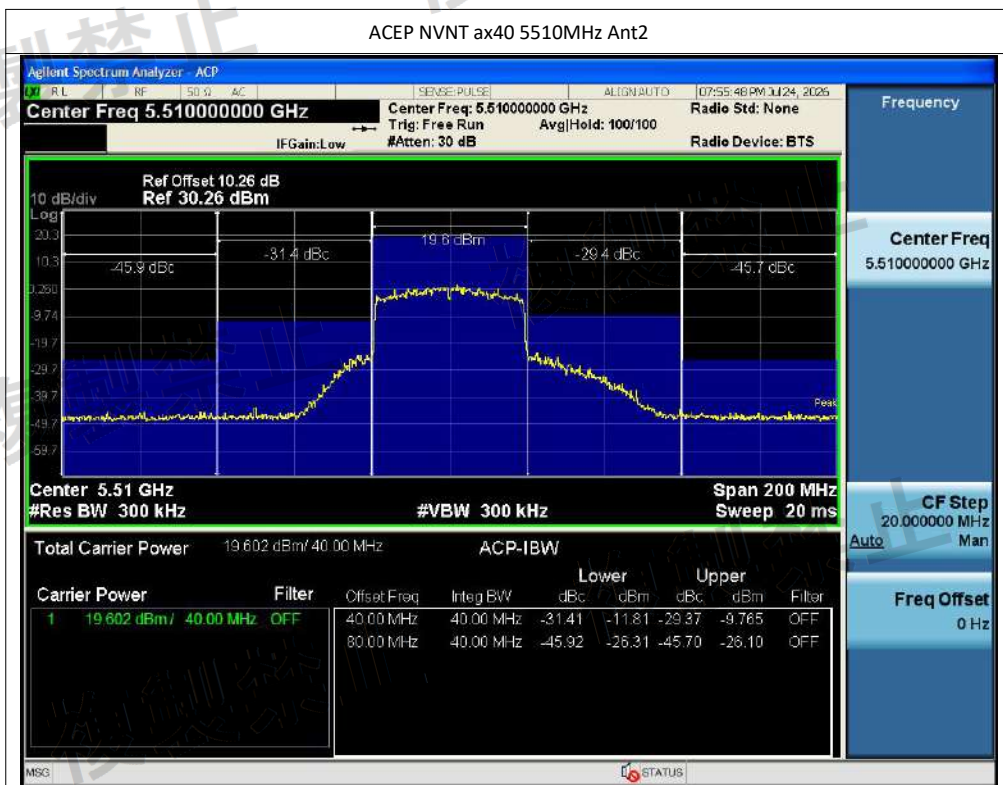


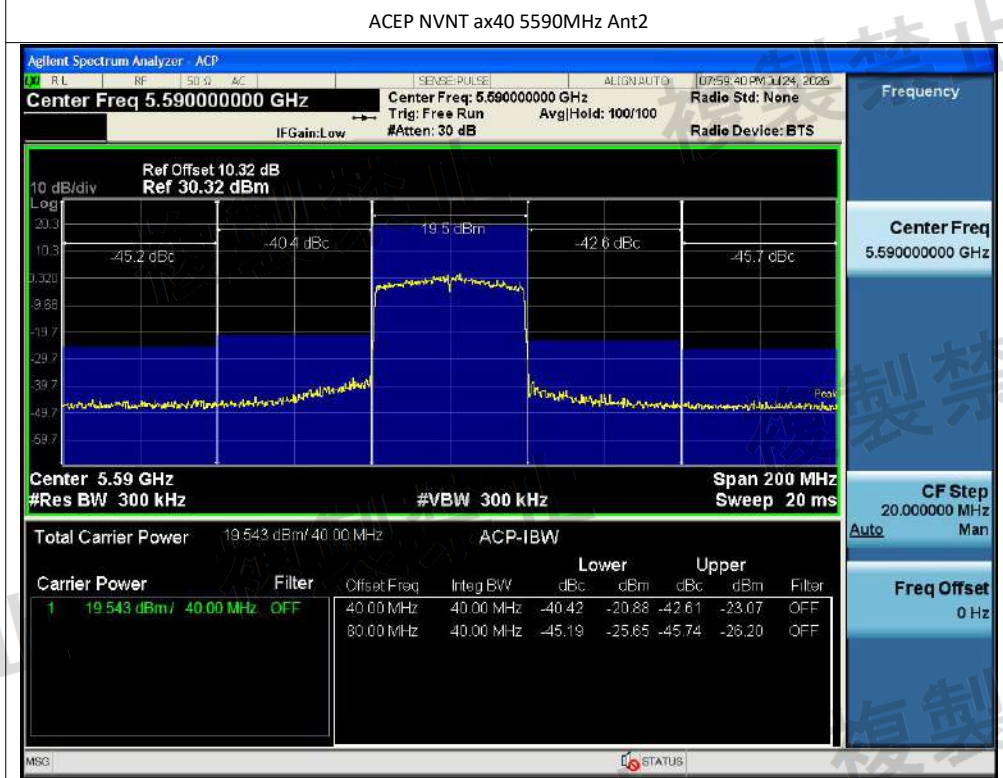
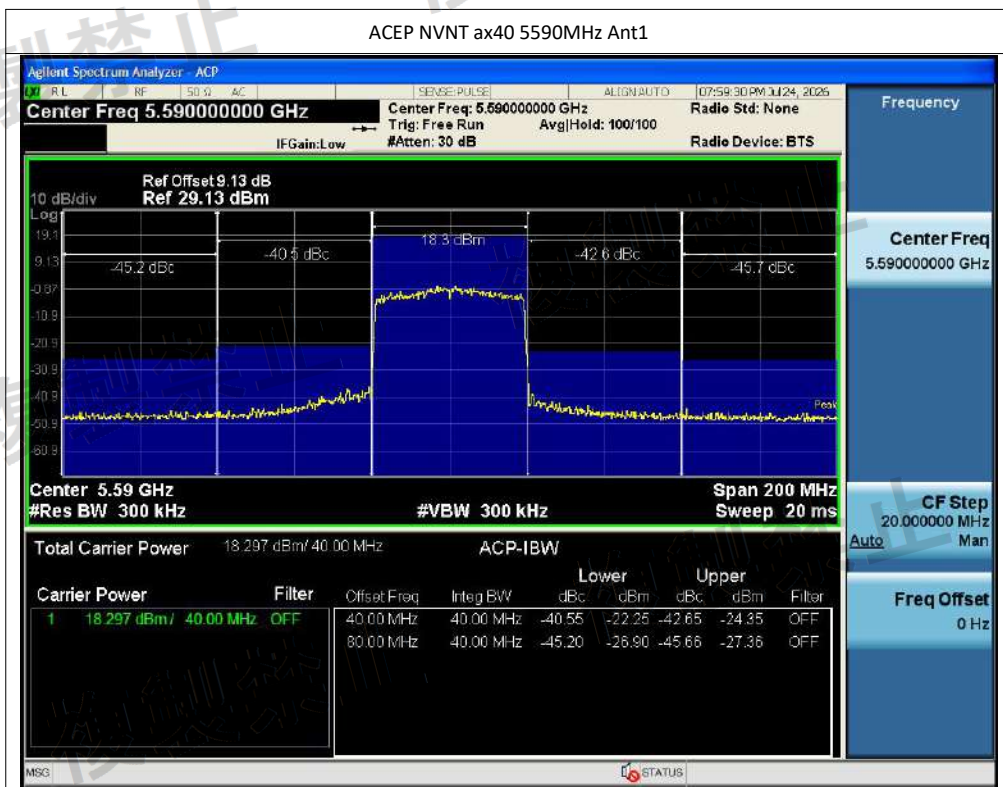


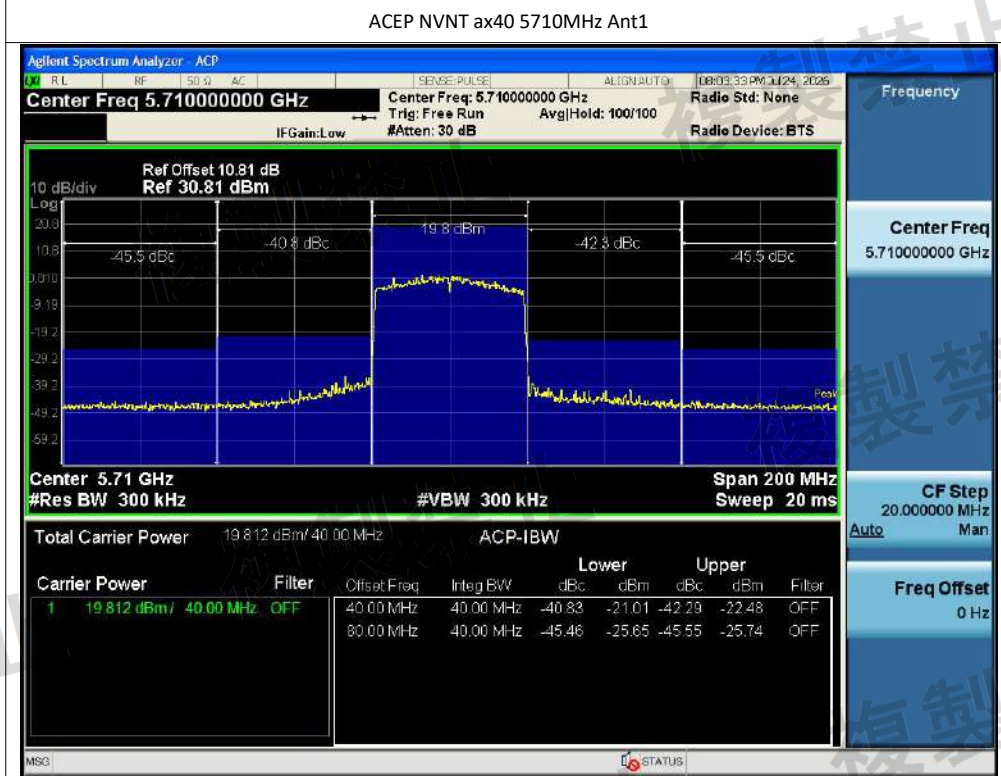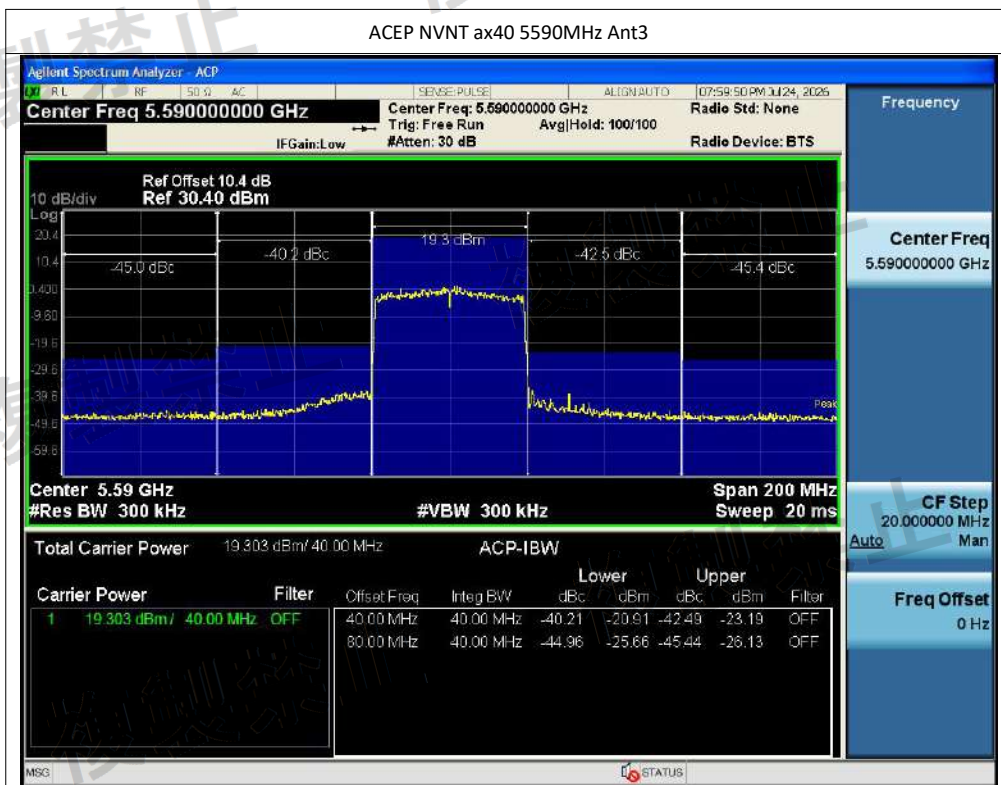


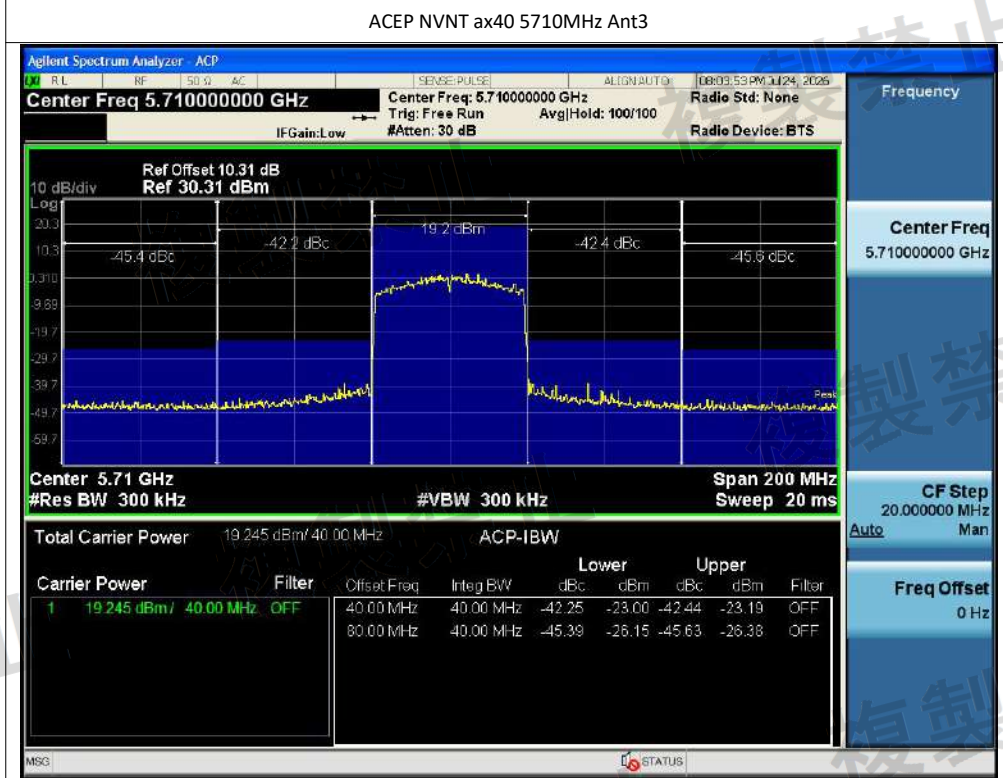
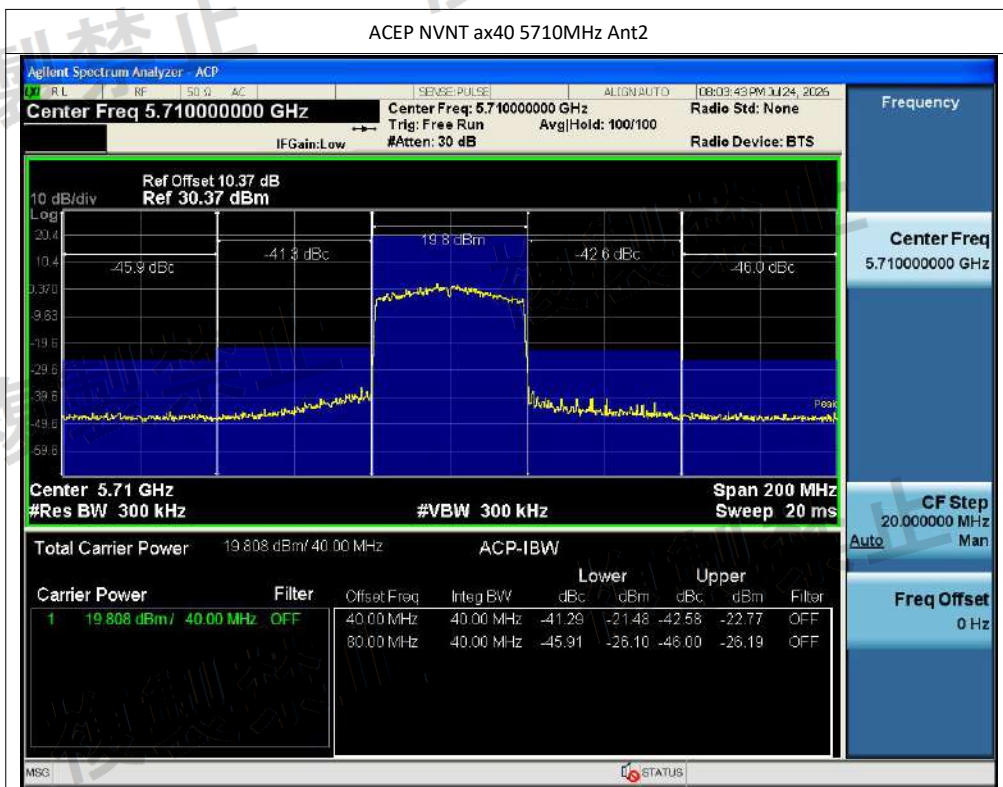


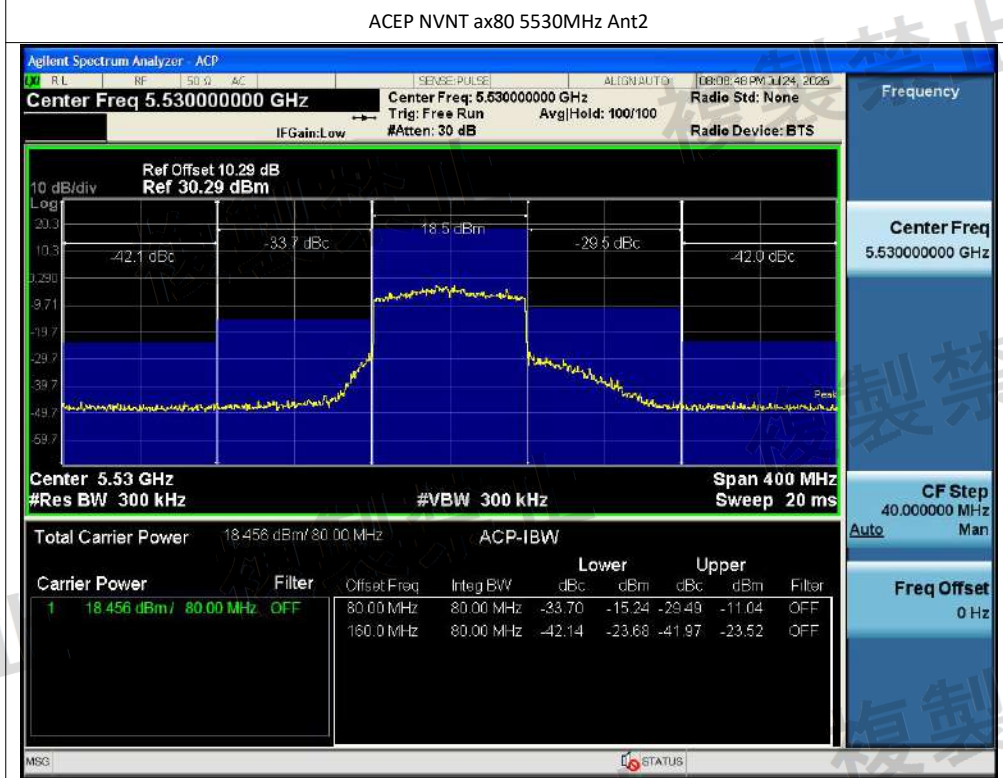
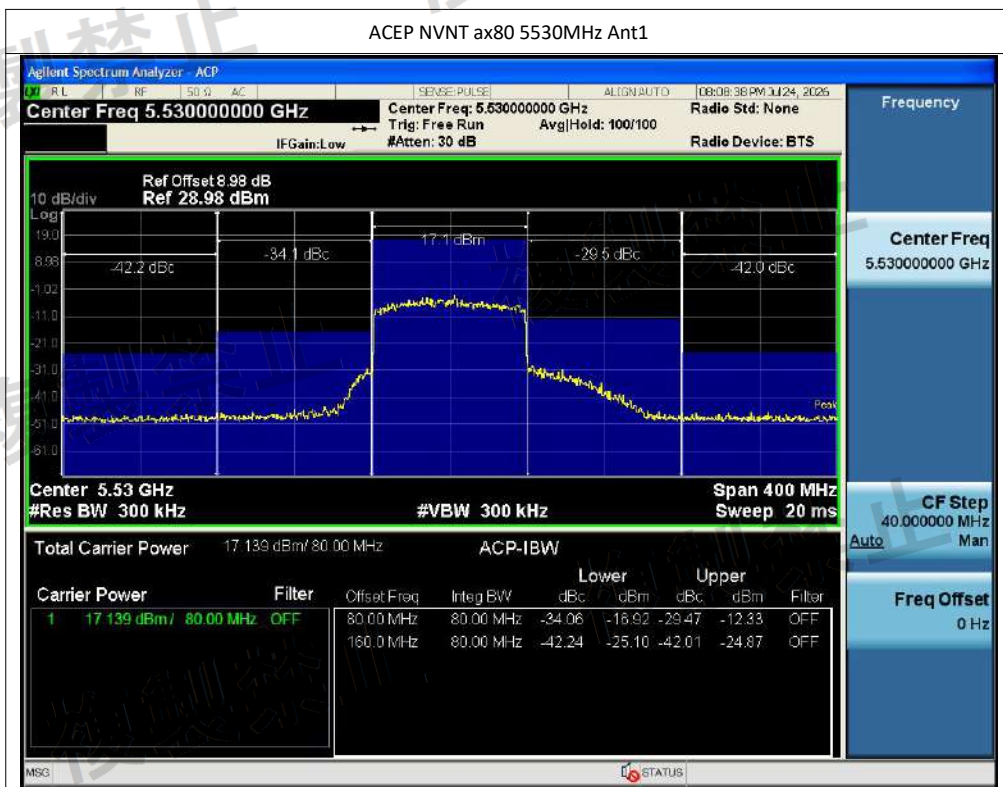


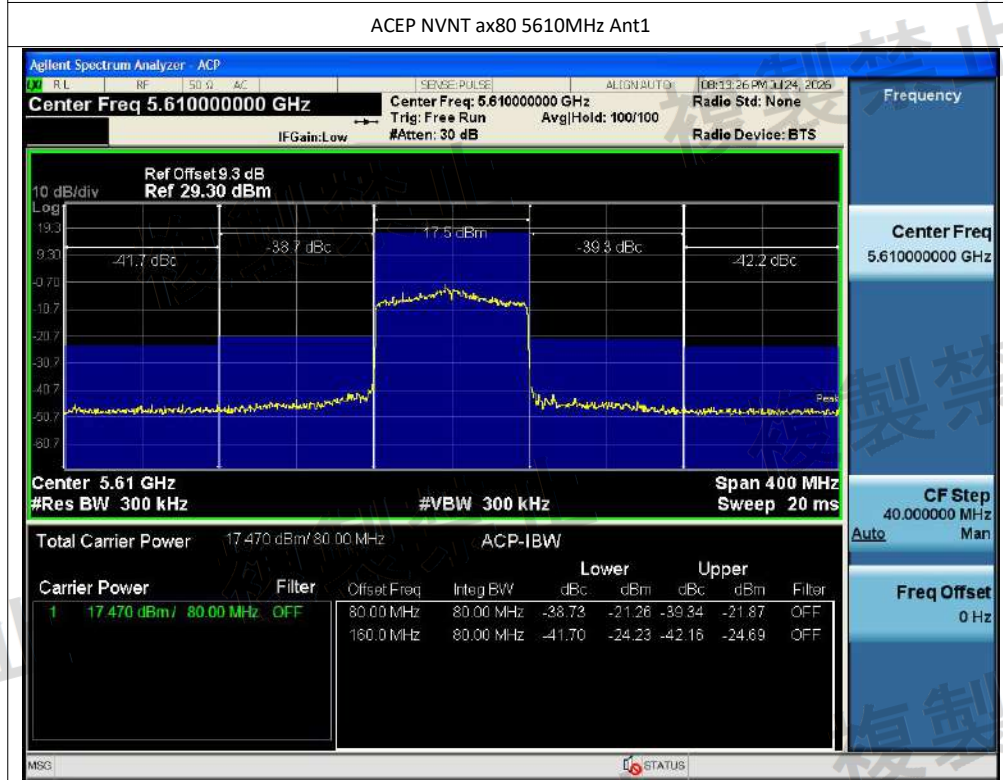
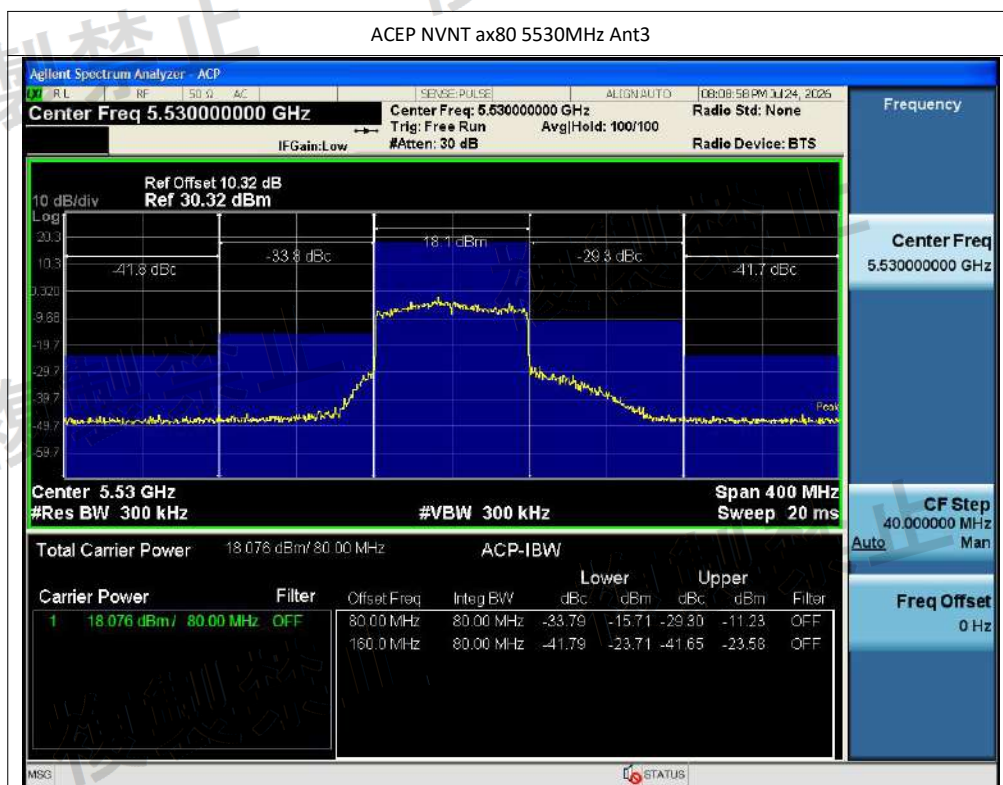


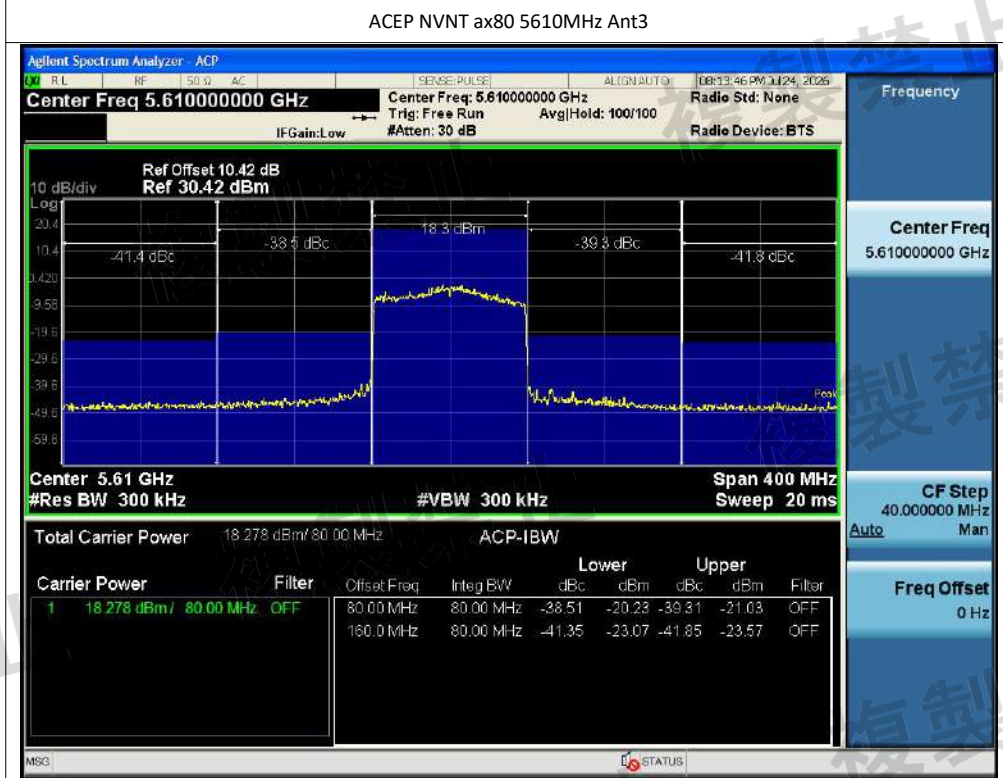
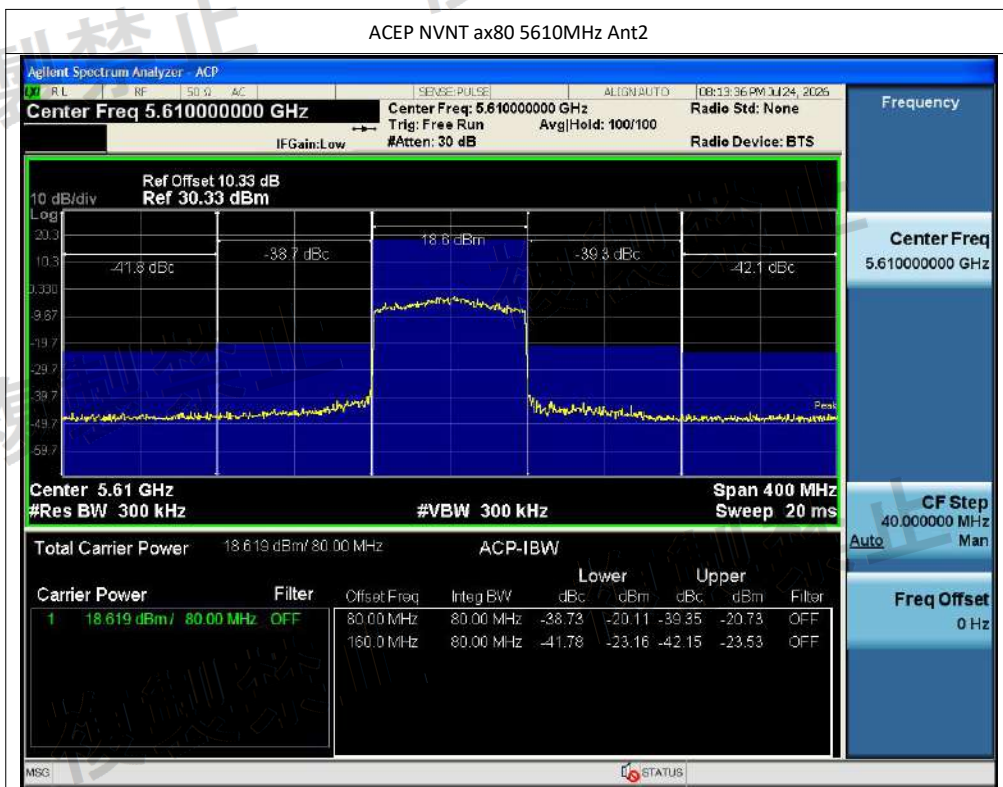



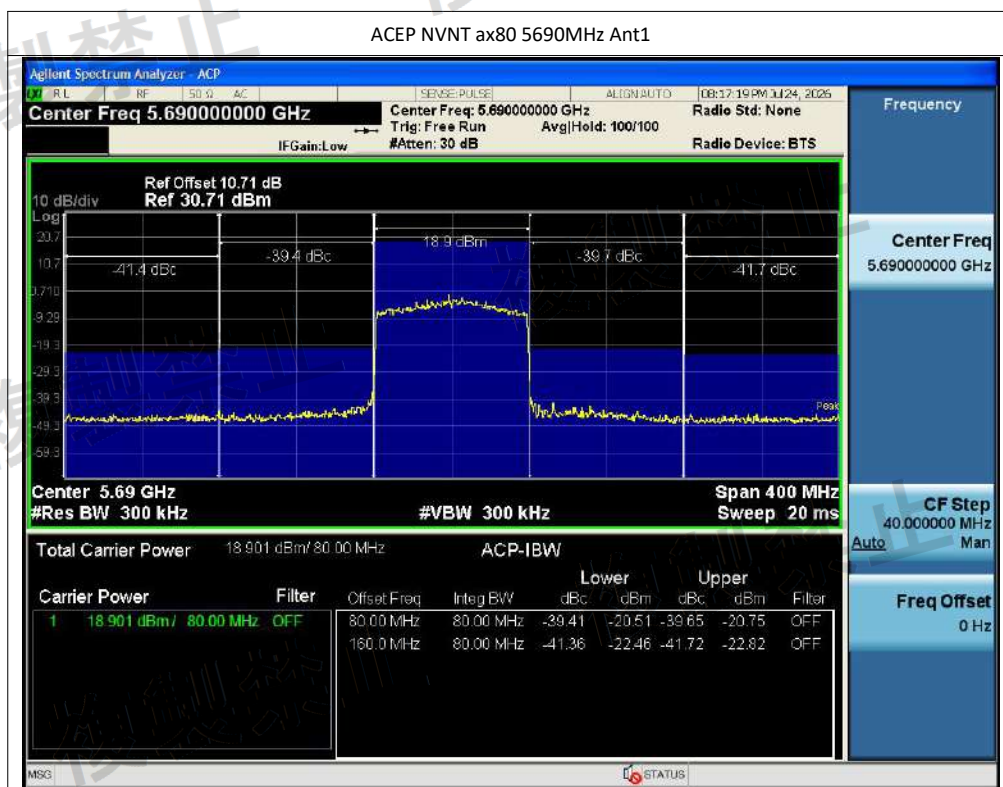


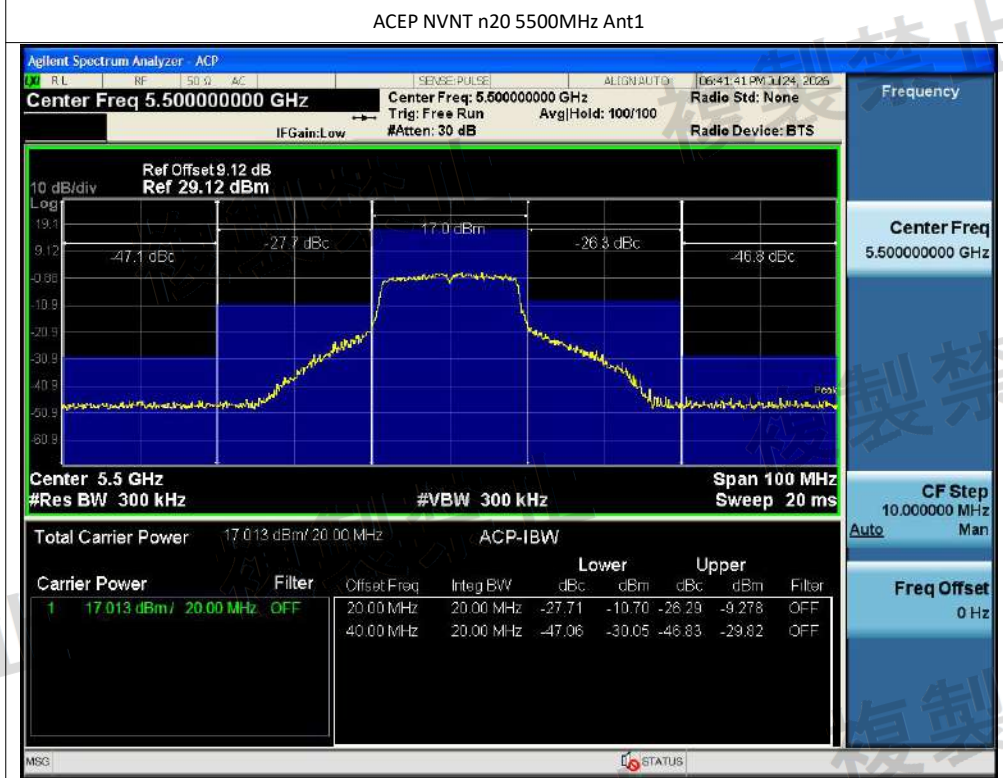
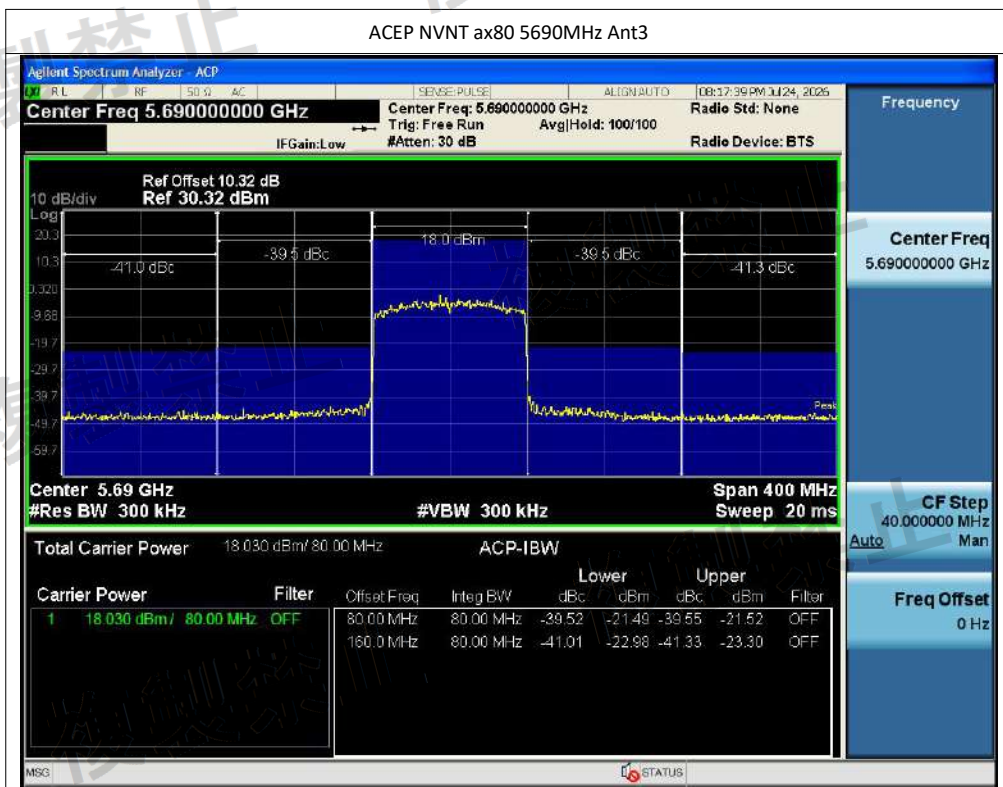


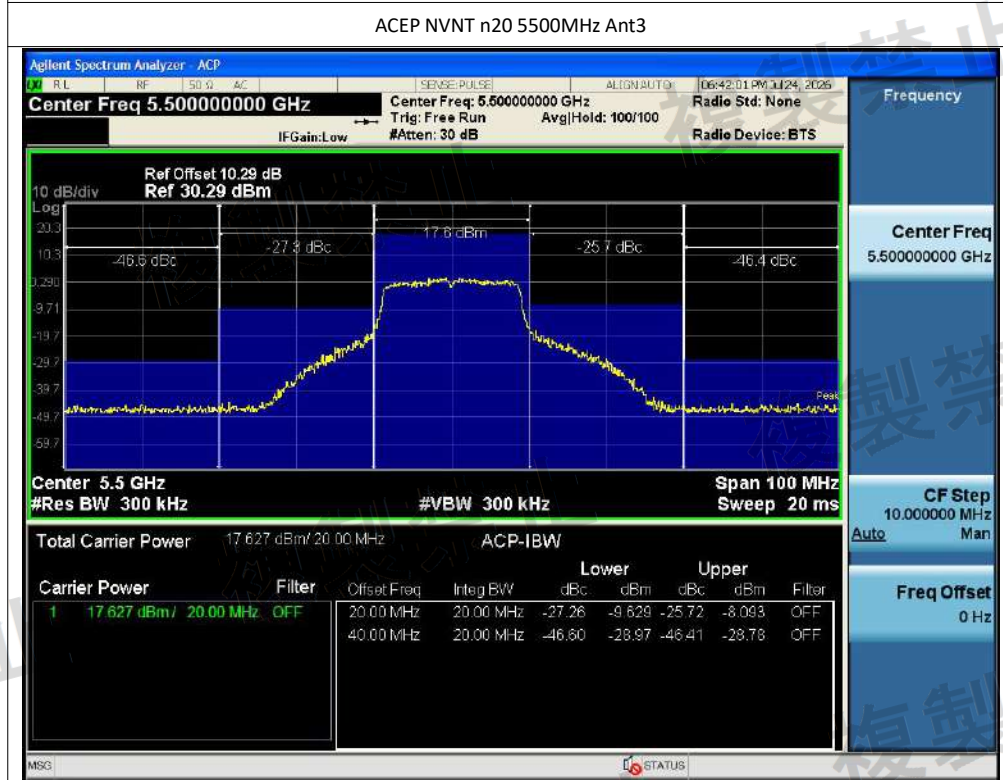
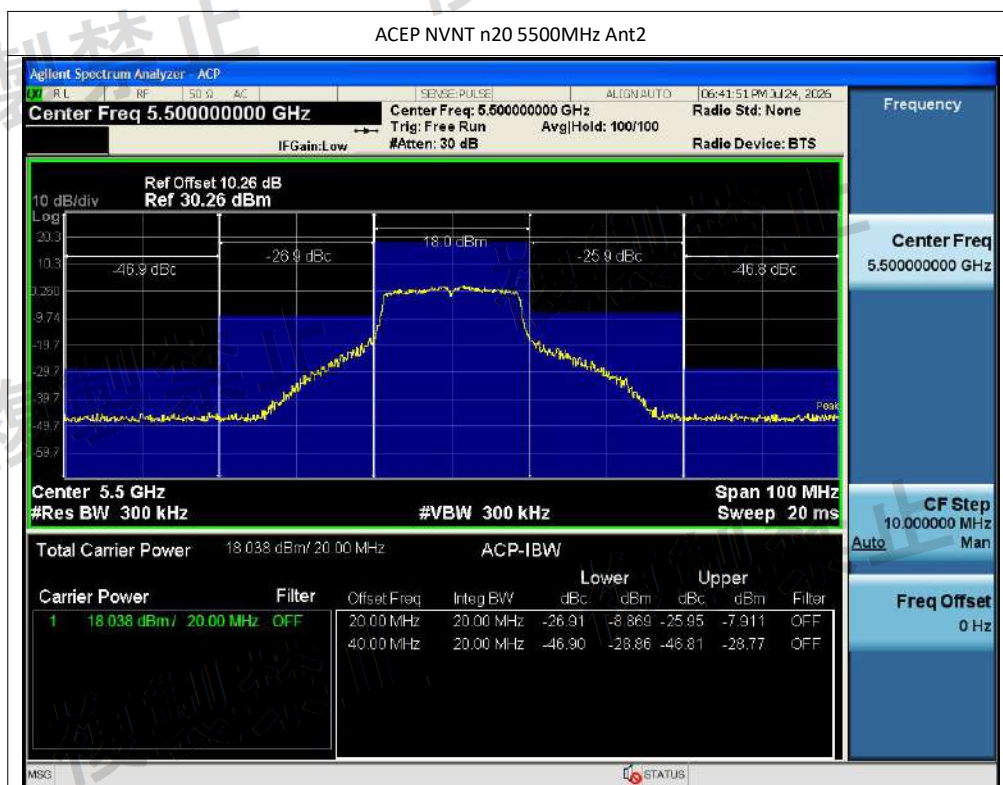


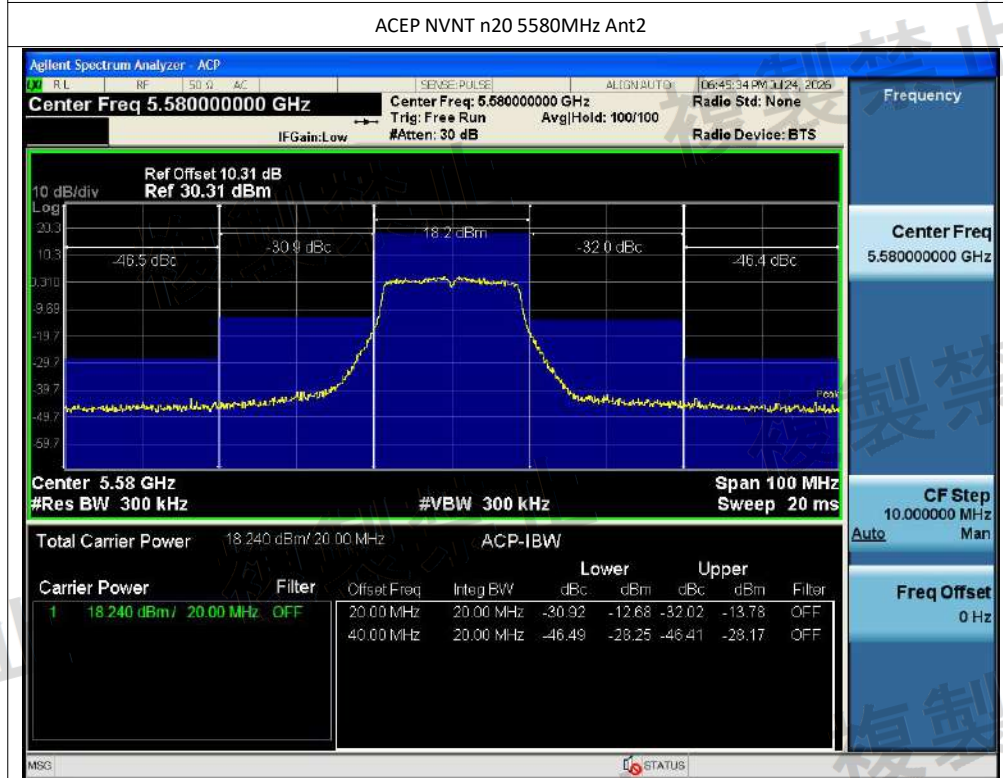
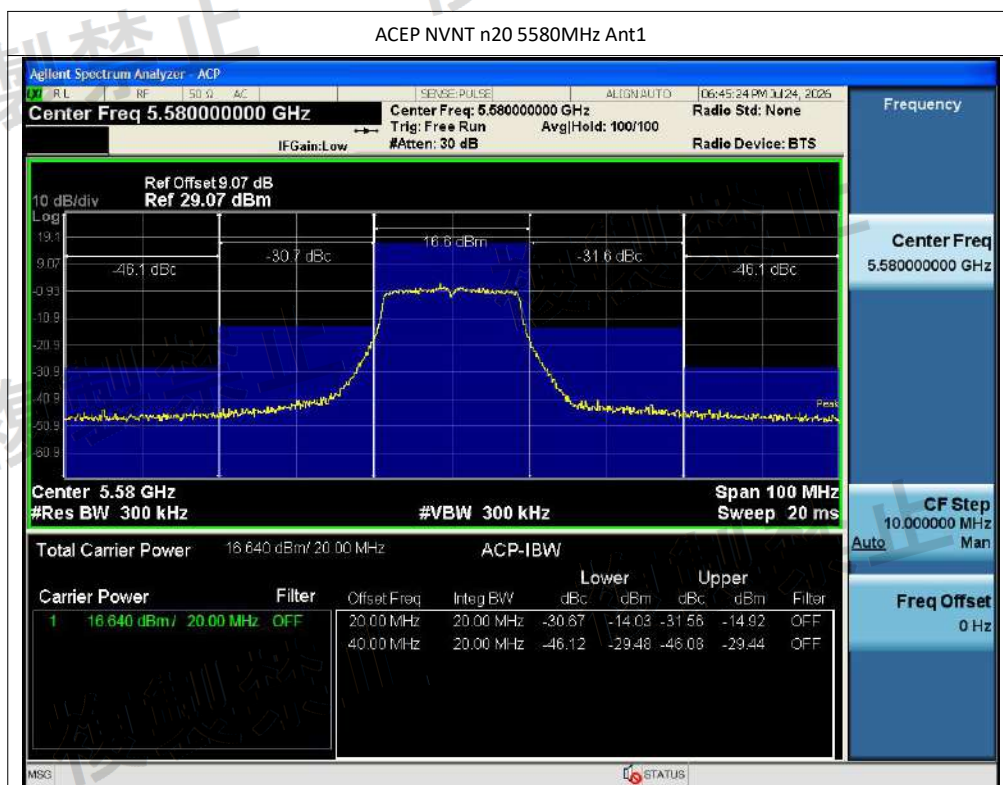


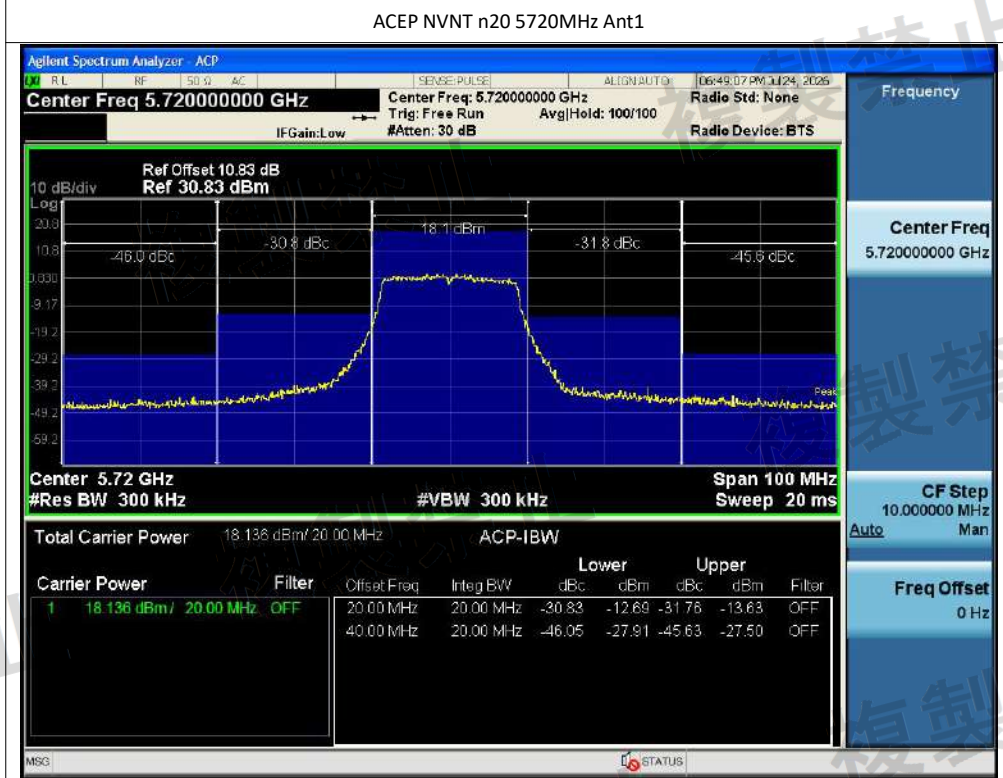
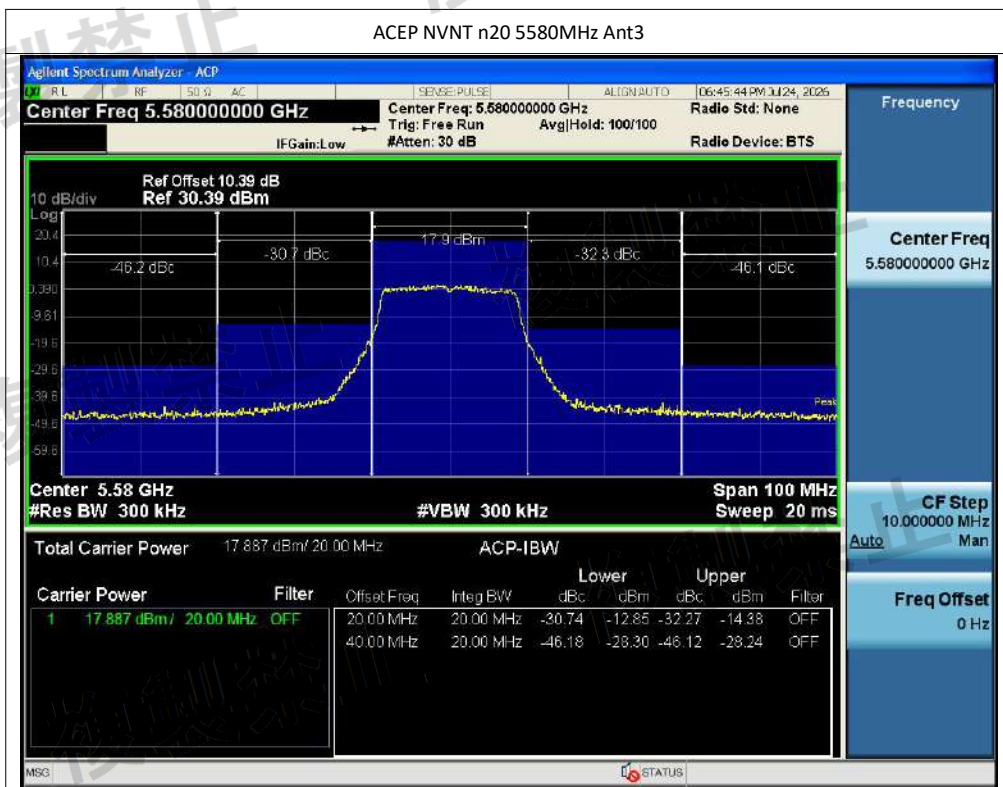


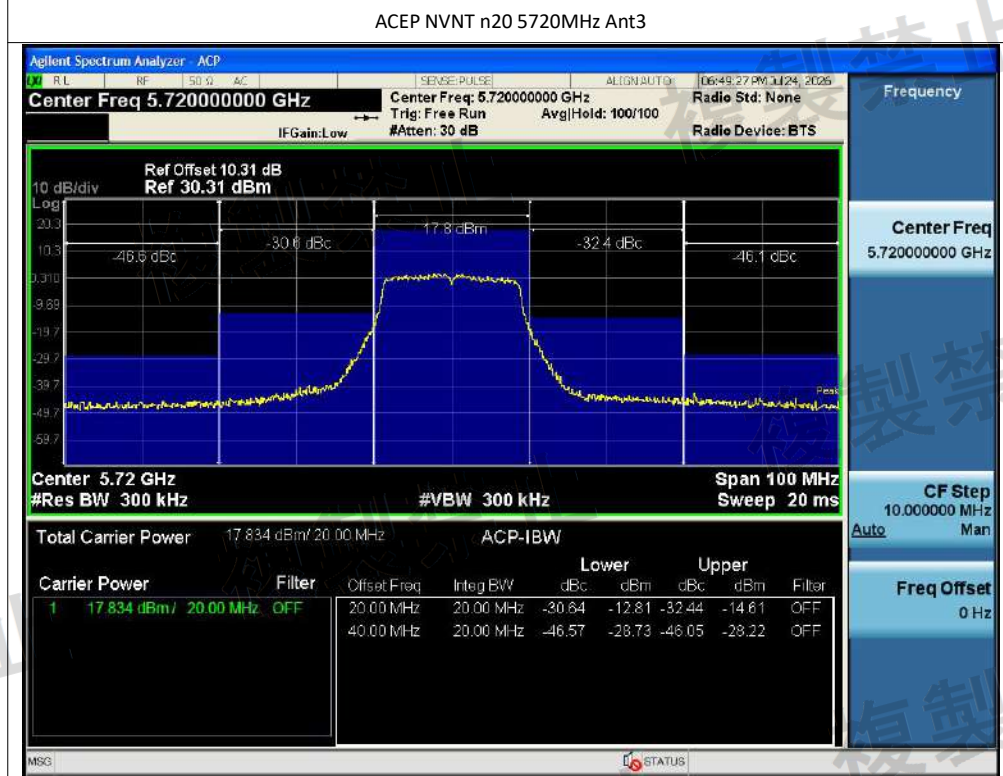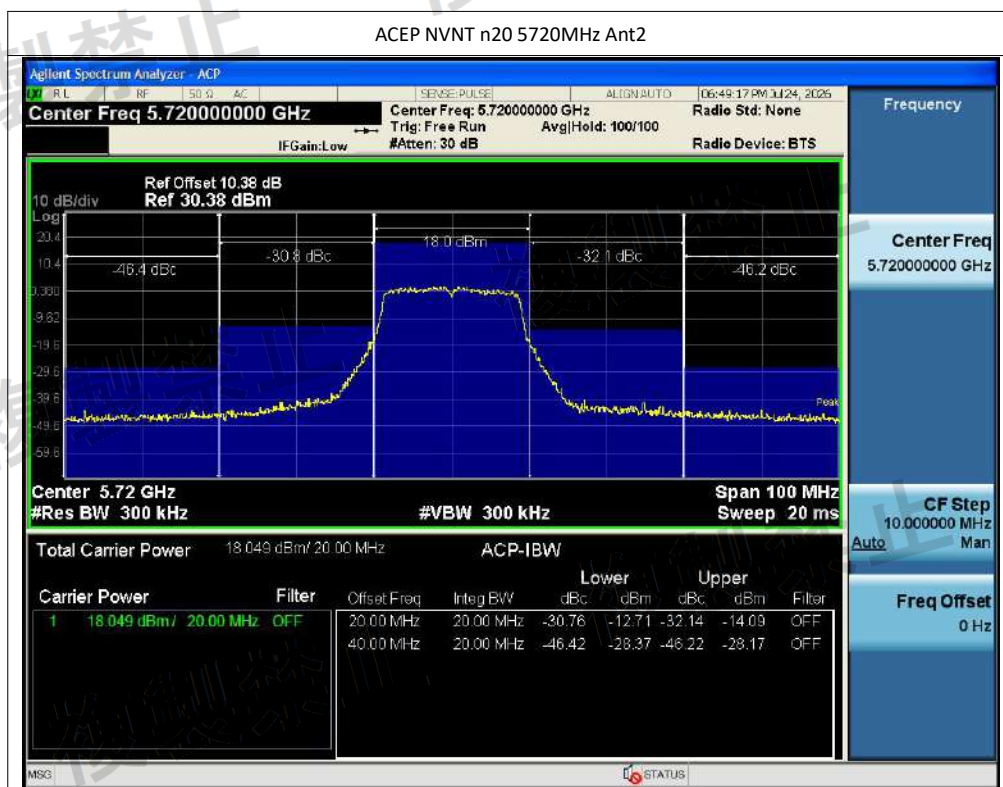


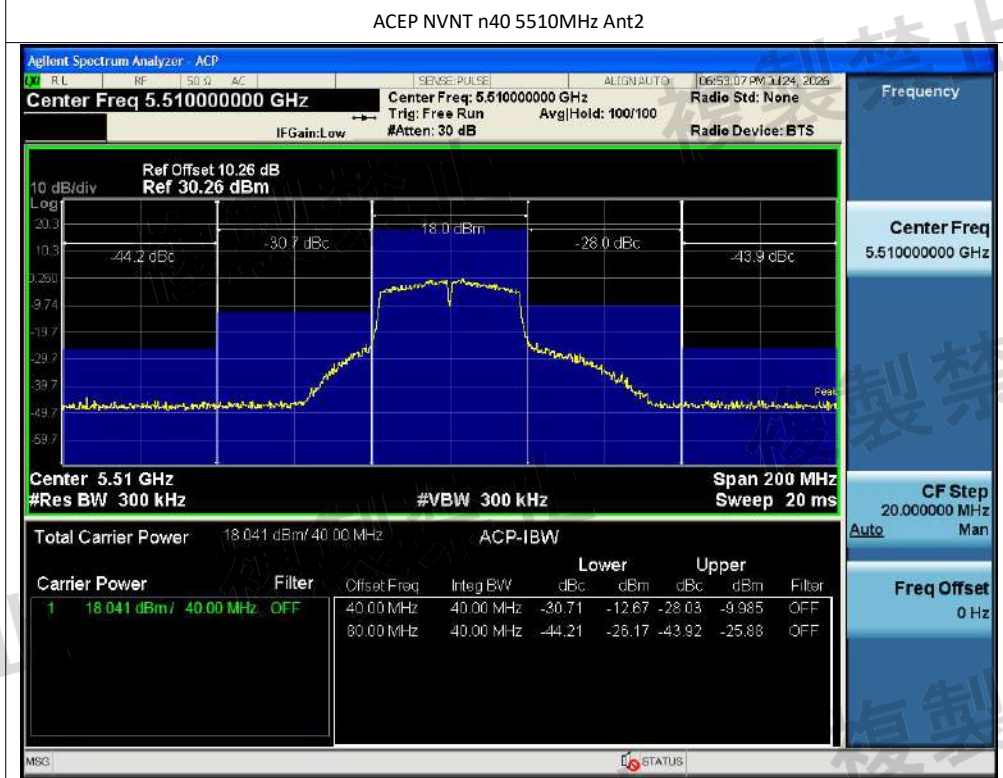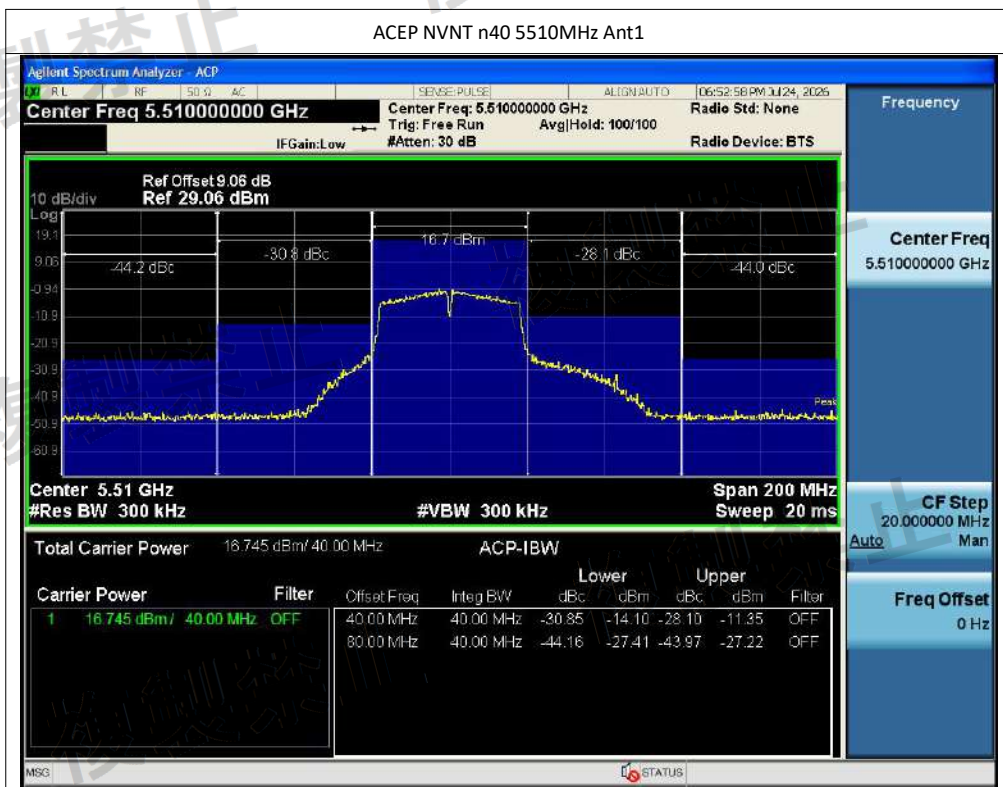

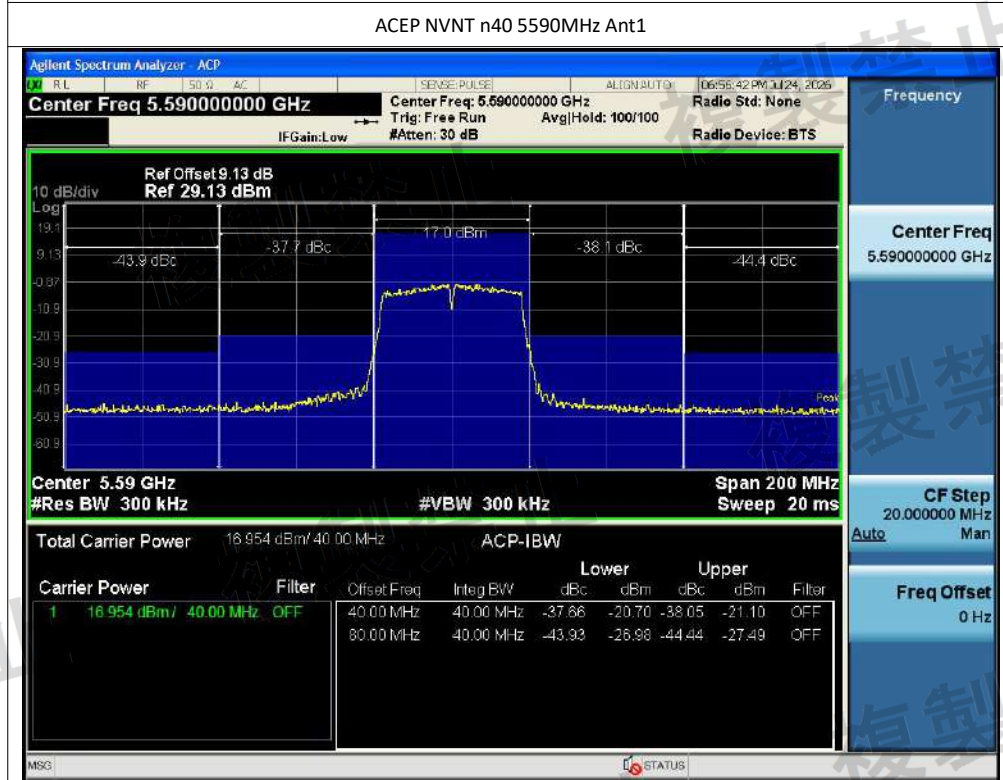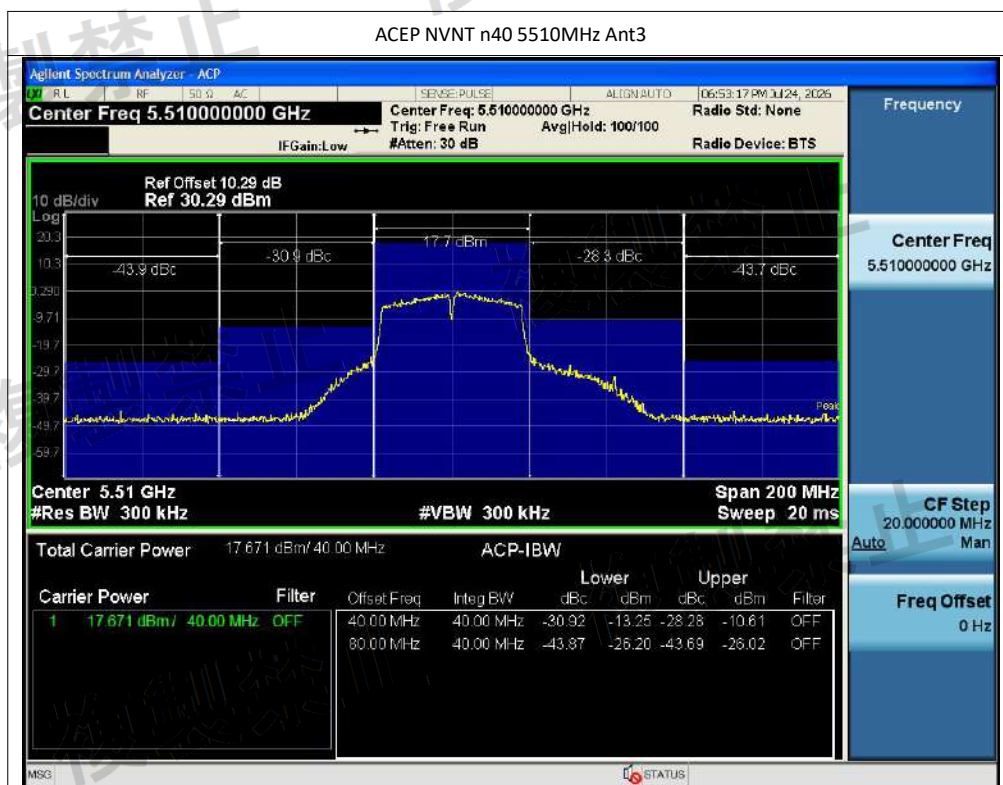

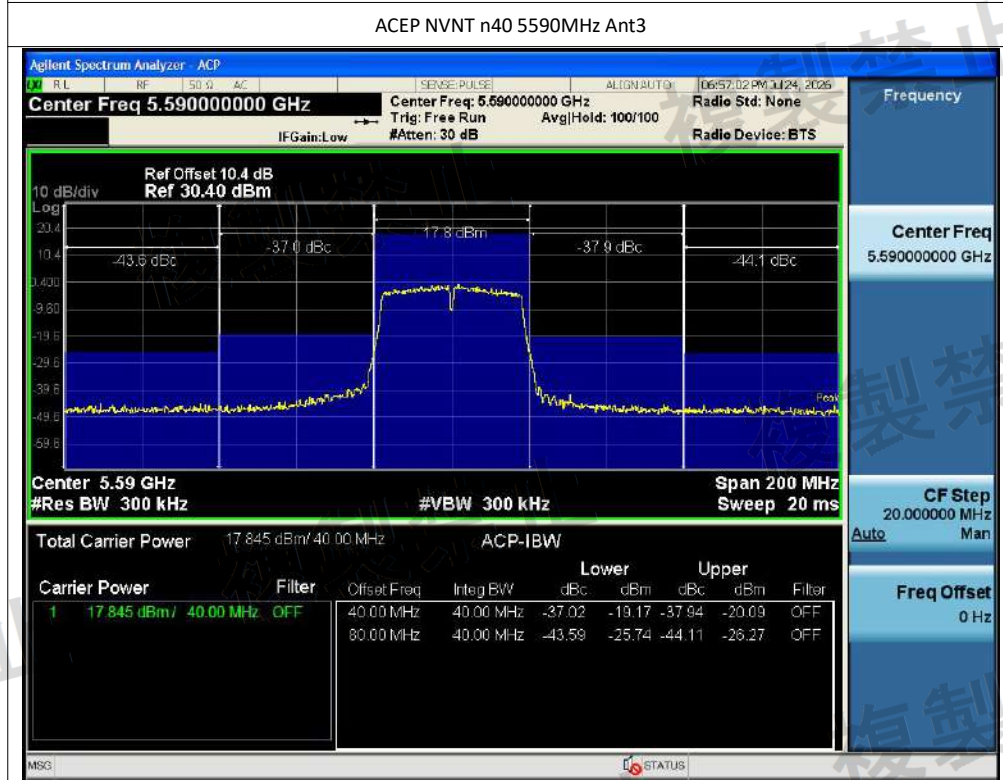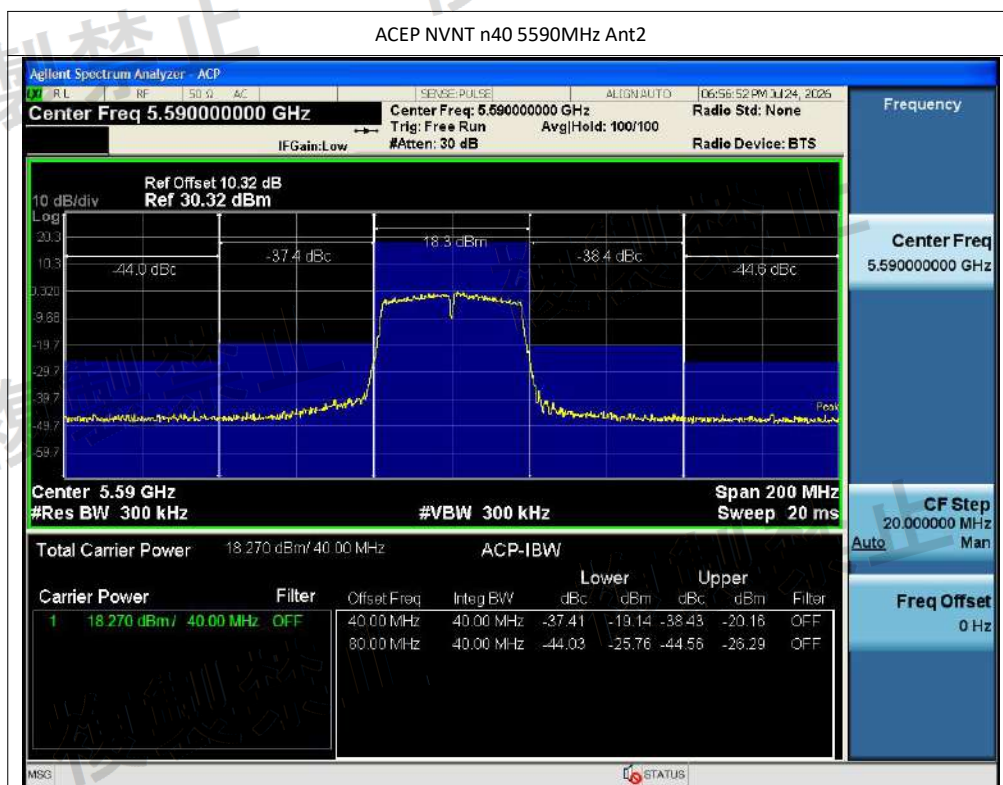

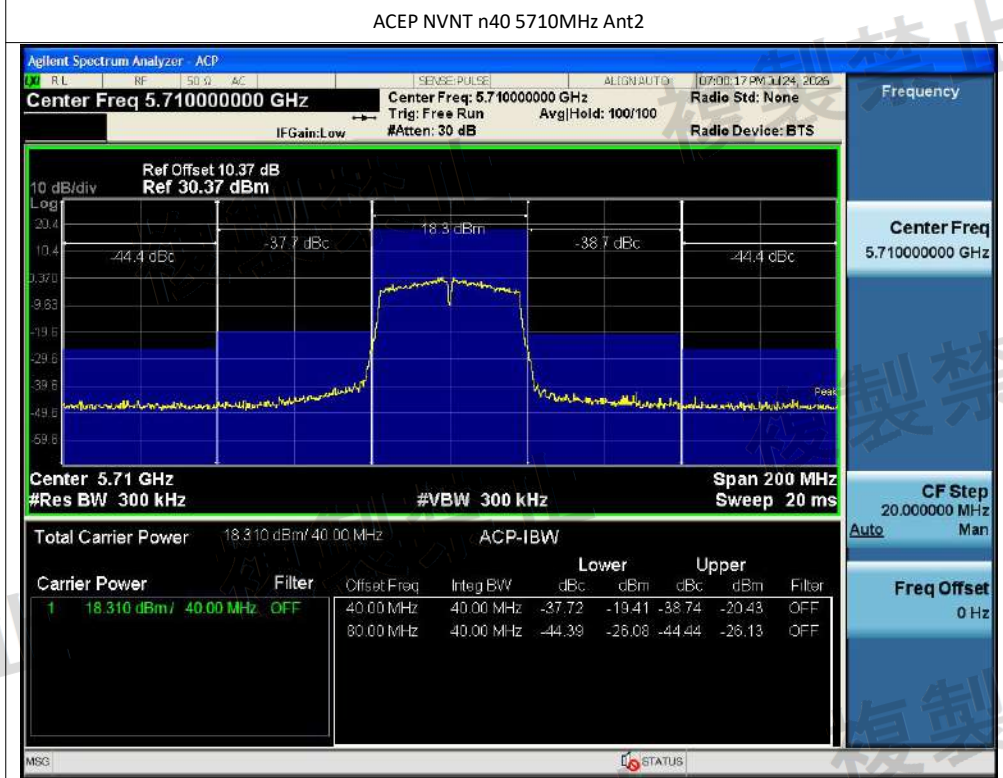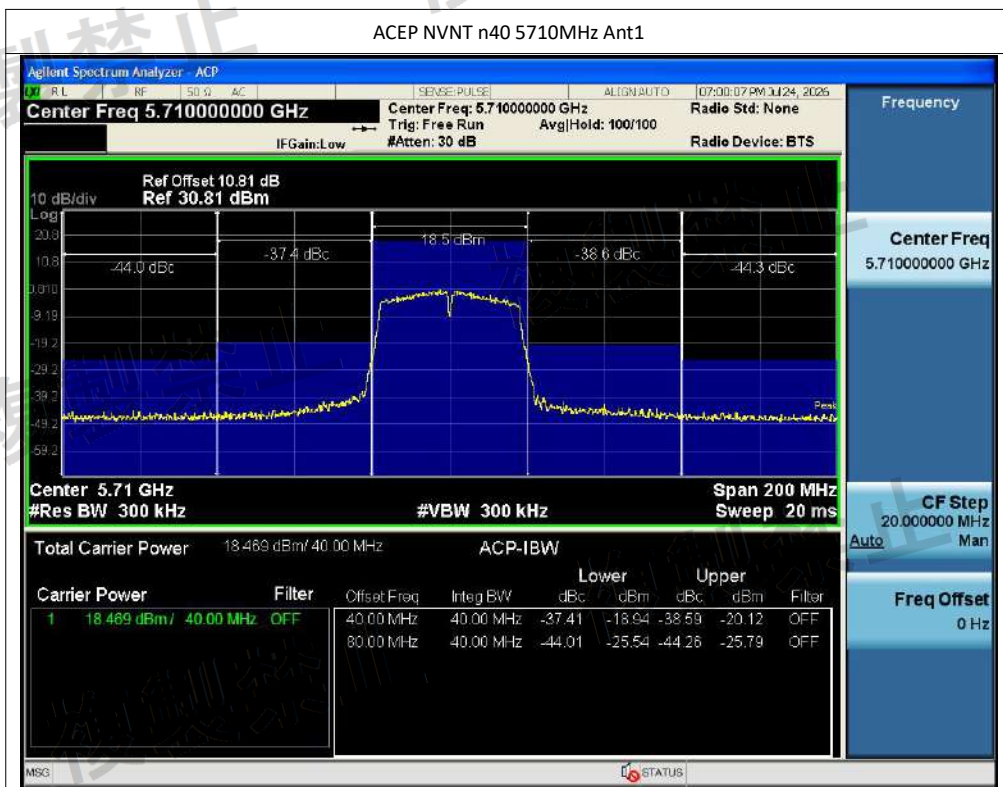

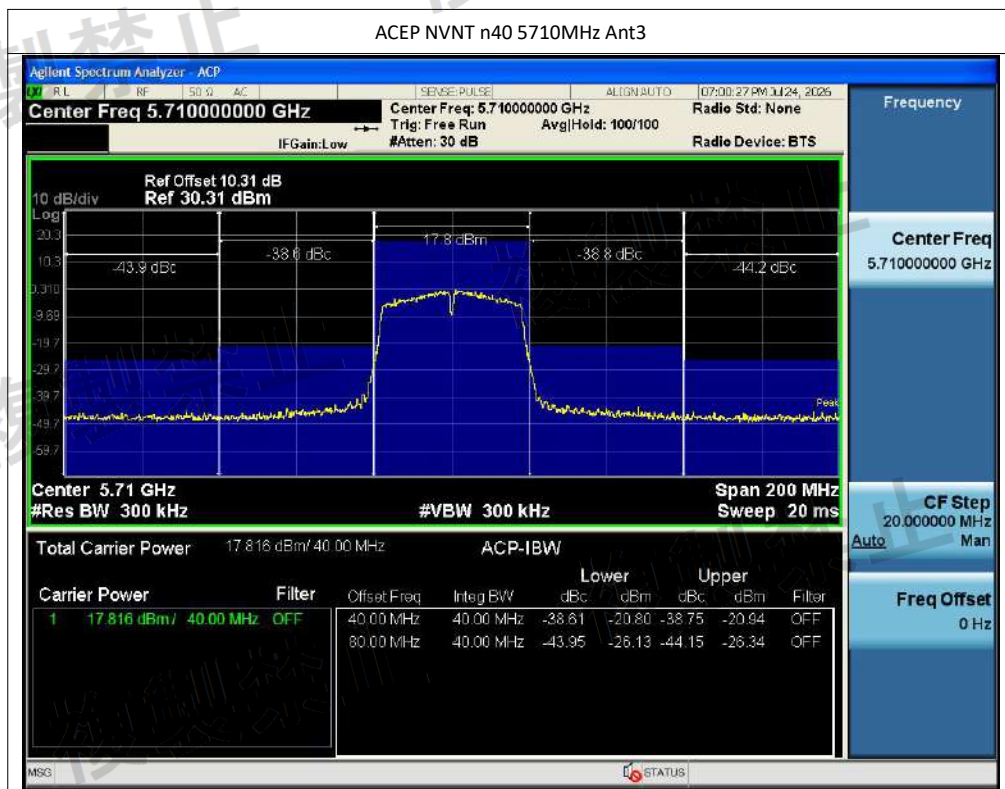


Frequency Error


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ax20	5500	Sum	5499.976	-24000	-4.36	20	Pass
NVNT	ax20	5580	Sum	5579.977	-23000	-4.12	20	Pass
NVNT	ax20	5720	Sum	5719.976	-24000	-4.2	20	Pass
NVNT	ax40	5510	Sum	5509.977	-23000	-4.17	20	Pass
NVNT	ax40	5590	Sum	5589.977	-23000	-4.11	20	Pass
NVNT	ax40	5710	Sum	5709.975	-25000	-4.38	20	Pass
NVNT	ax80	5530	Sum	5529.976	-24000	-4.34	20	Pass
NVNT	ax80	5610	Sum	5609.976	-24000	-4.28	20	Pass
NVNT	ax80	5690	Sum	5689.974	-26000	-4.57	20	Pass



Test Graphs



Freq. Error NVNT ax20 5500MHz Sum


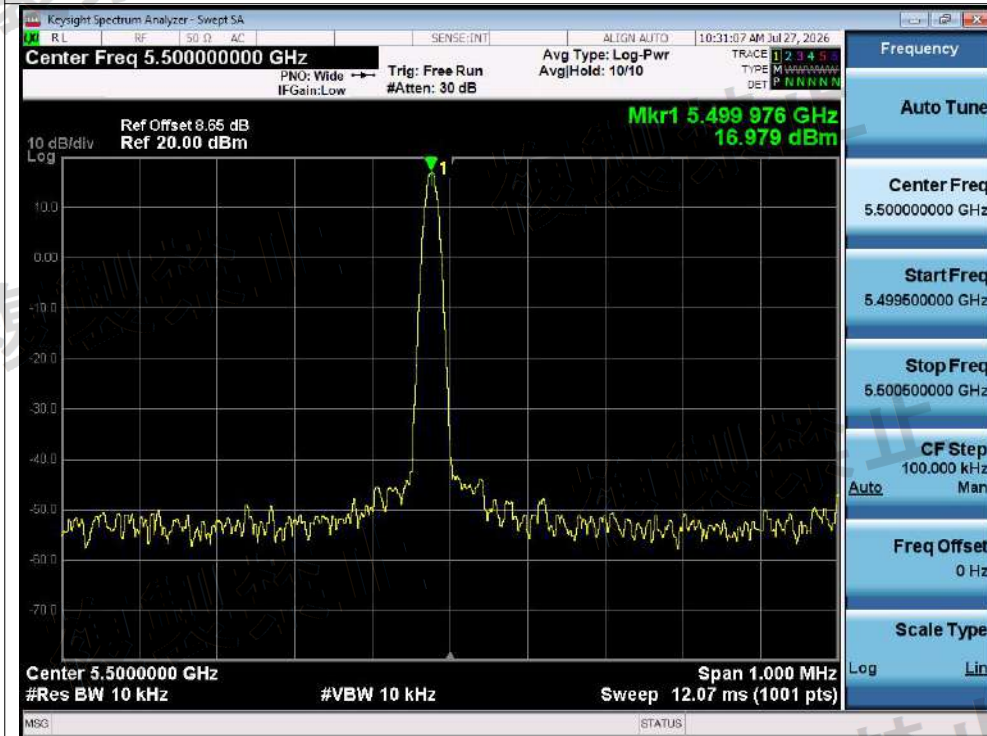



Freq. Error NVNT ax20 5580MHz Sum

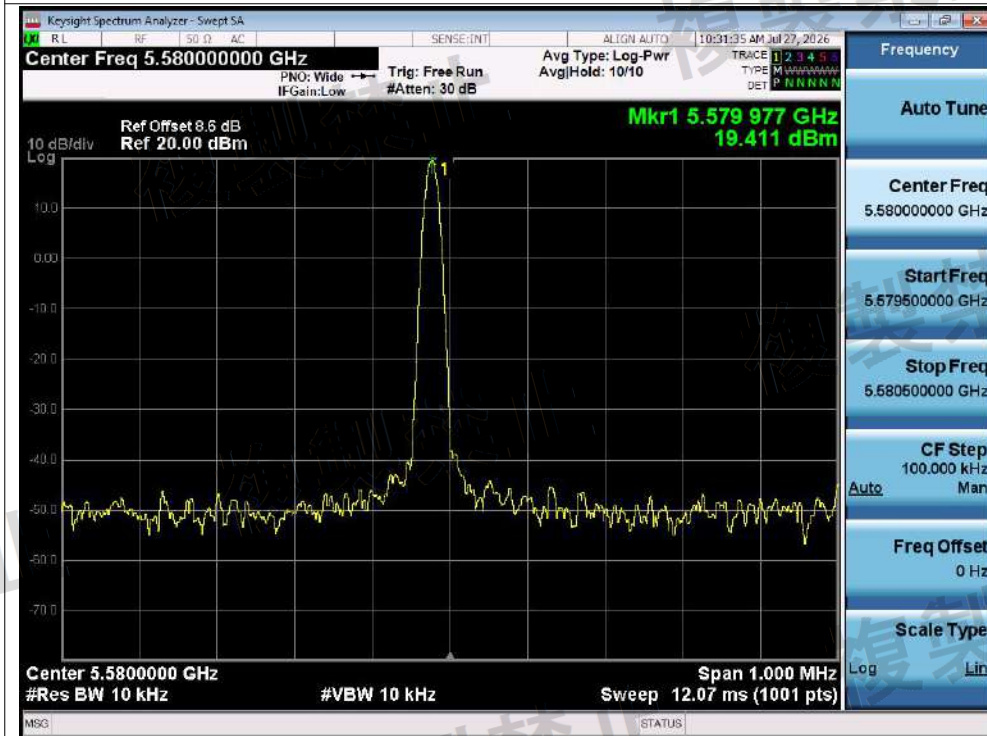

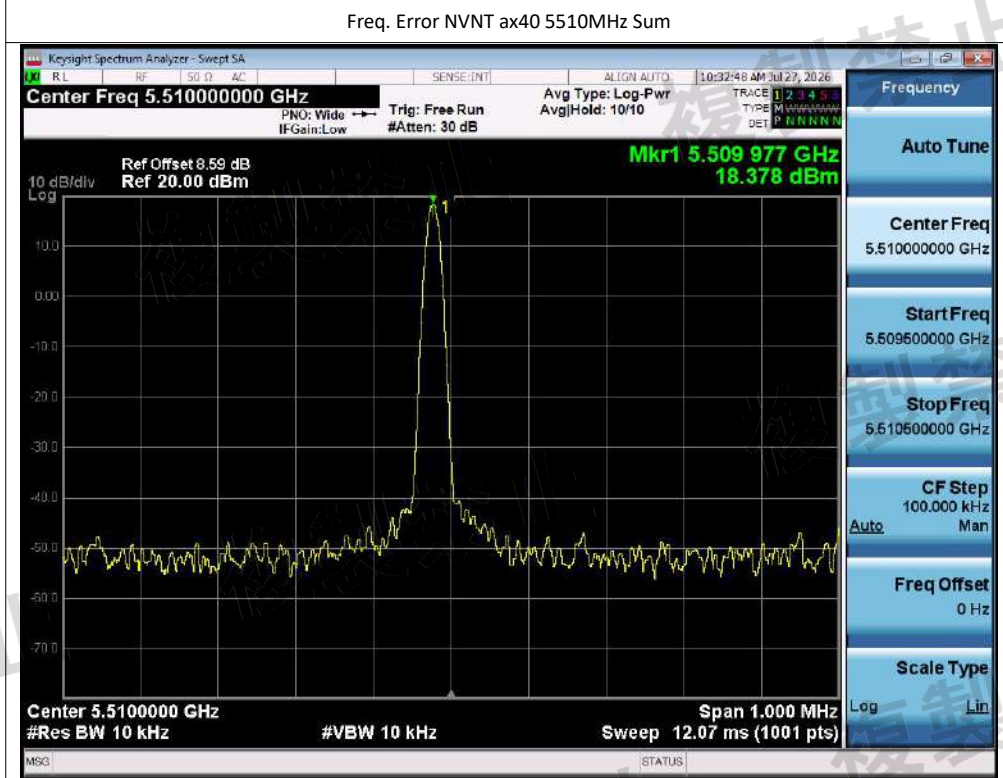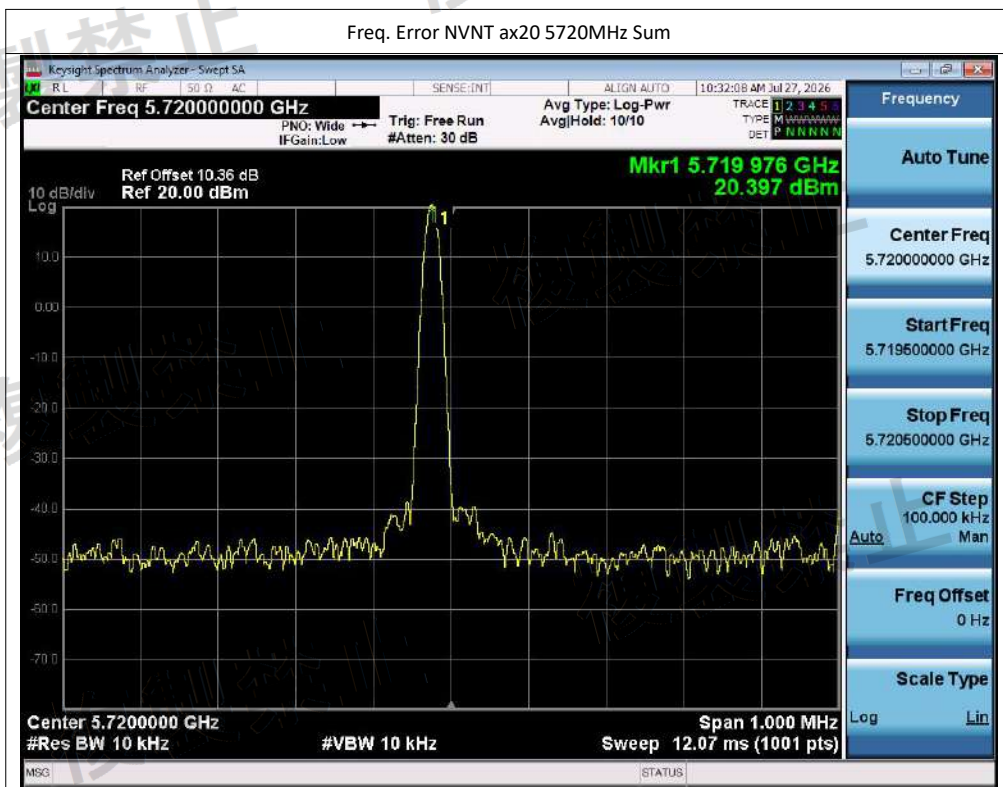

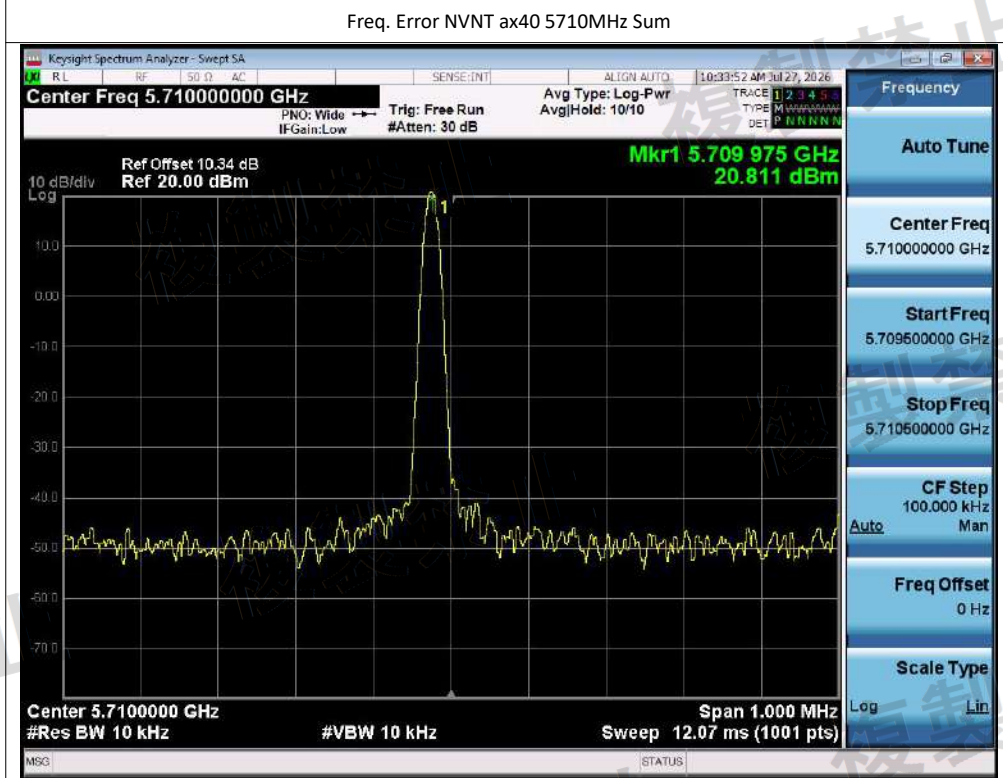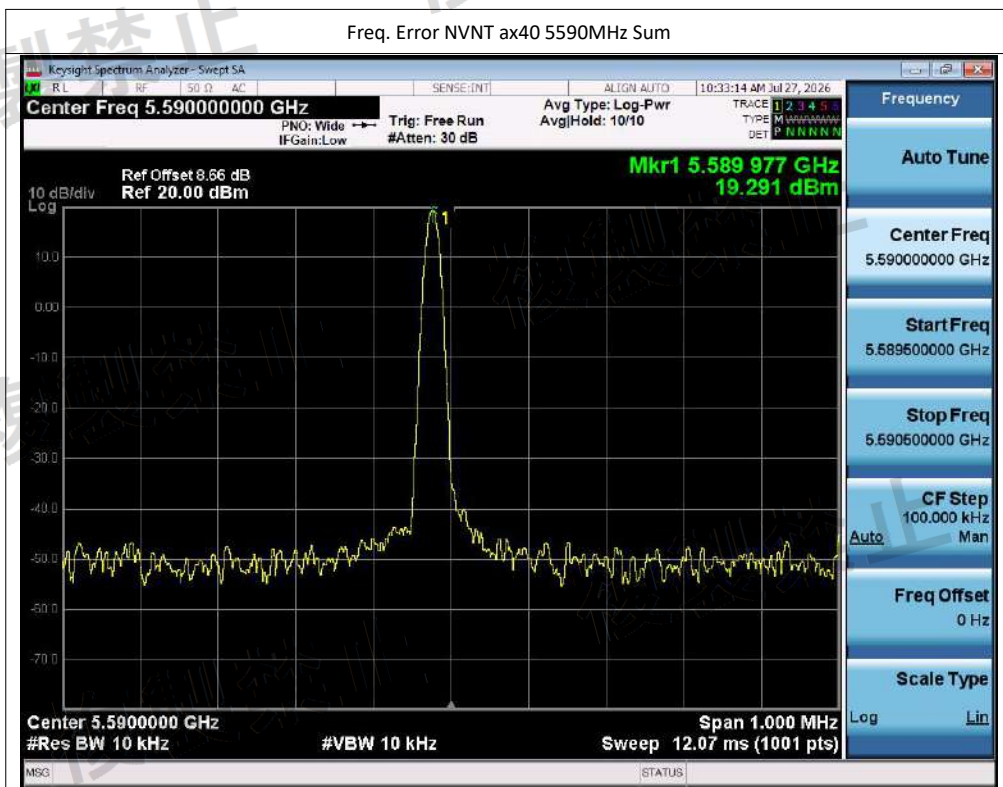


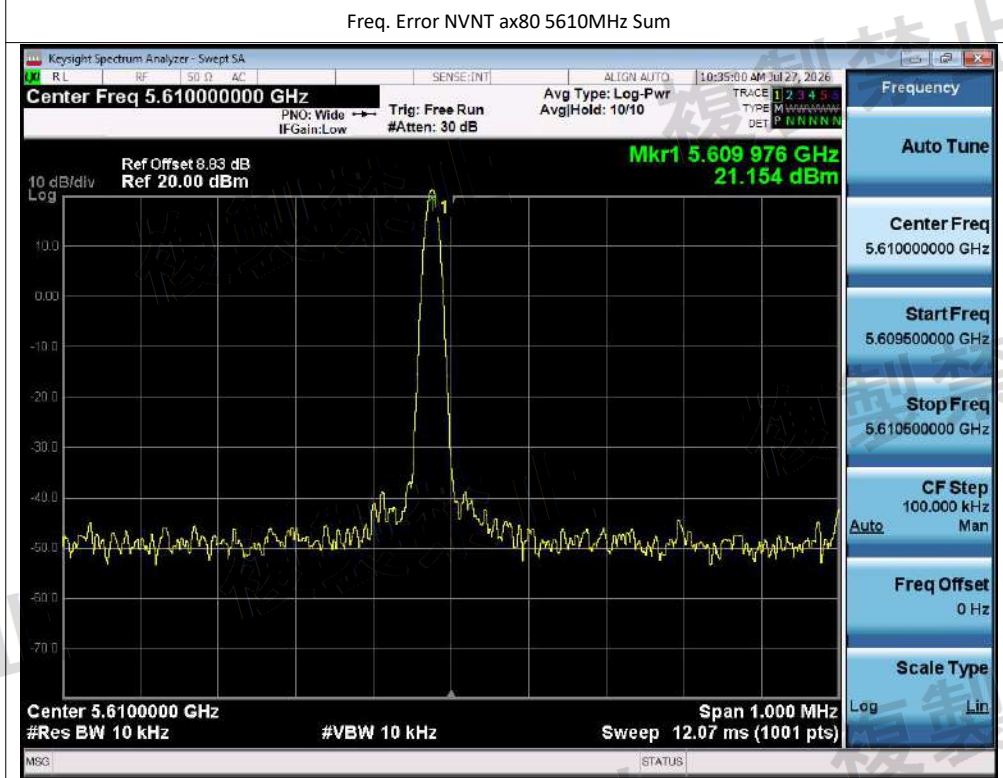
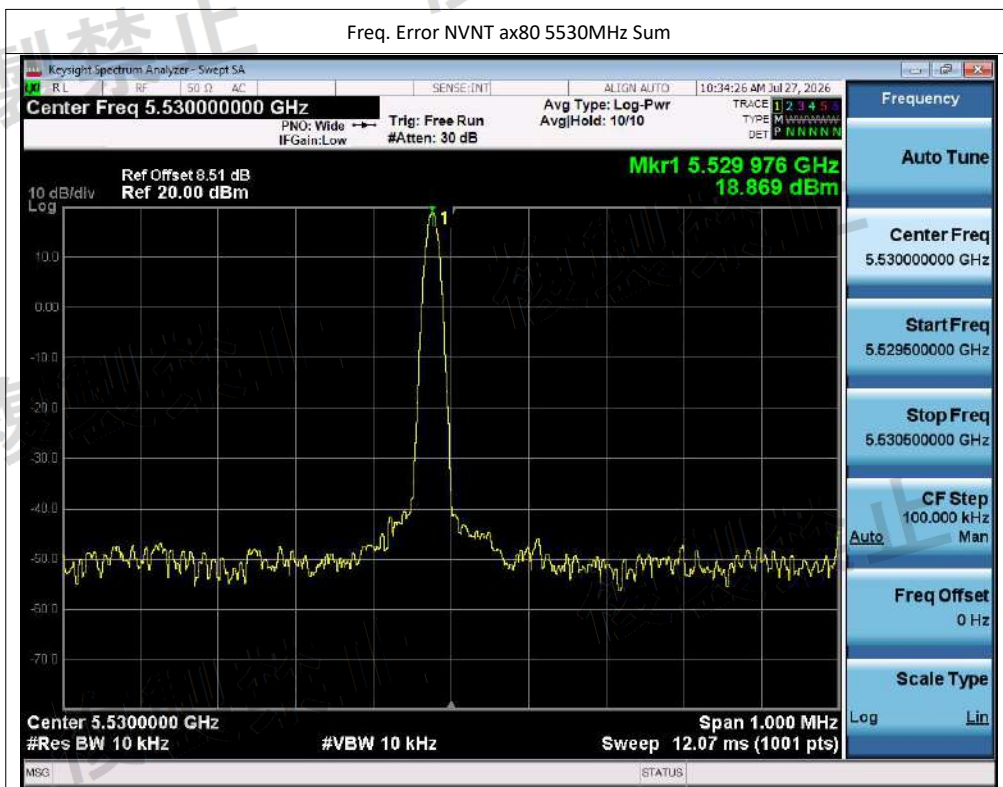


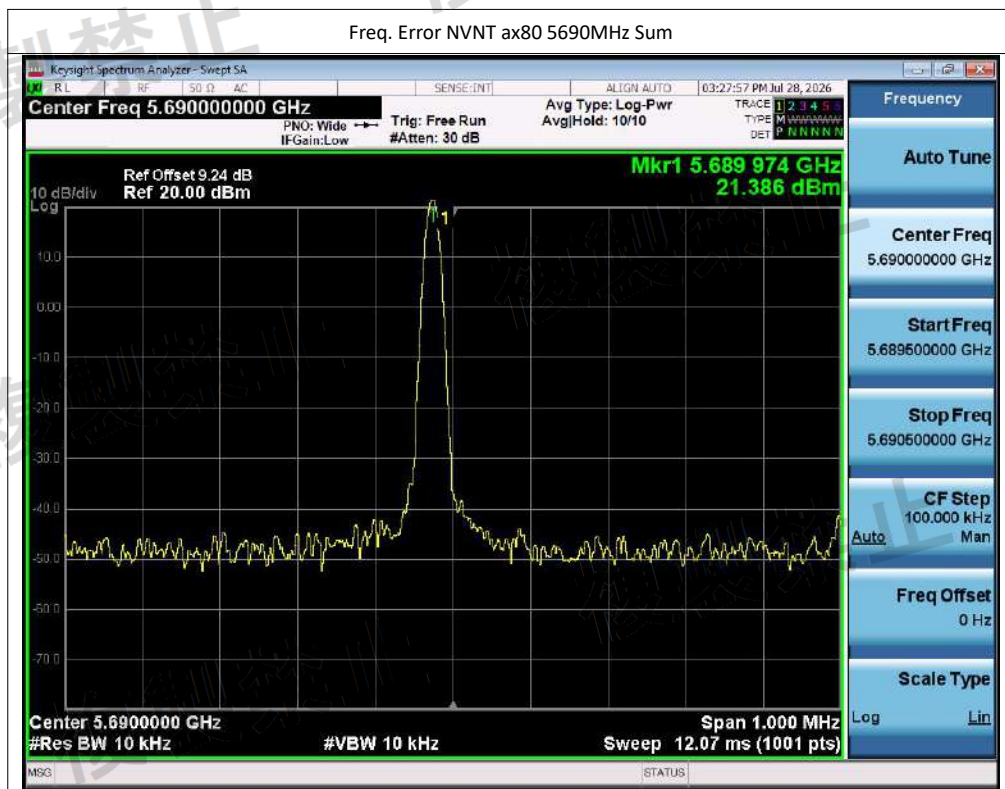

Carrier Sense


Condition	Mode	Frequency (MHz)	Antenna	CW Level (dBm)	Verdict
NVNT	ax80	5530	Sum	-45.59	Pass
NVNT	ax80	5610	Sum	-45.72	Pass
NVNT	ax80	5690	Sum	-45.84	Pass

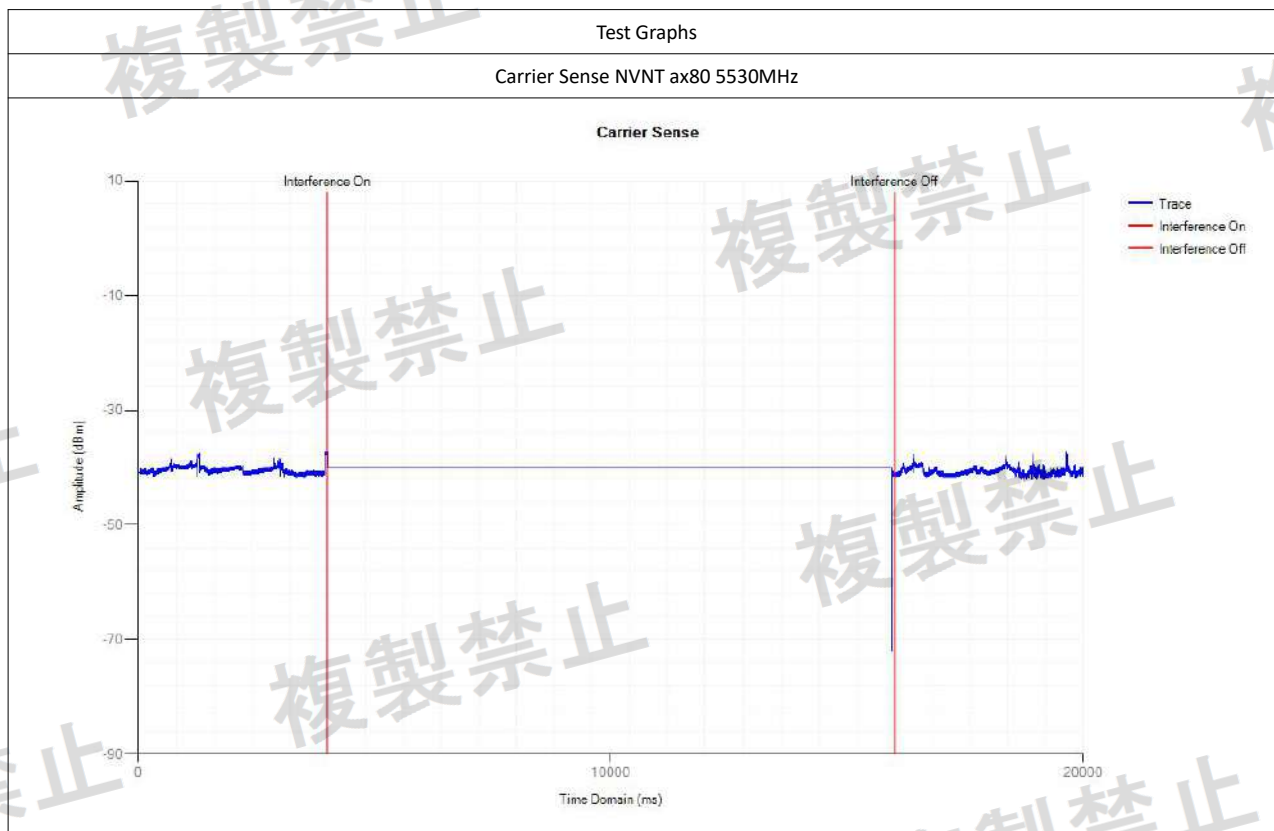

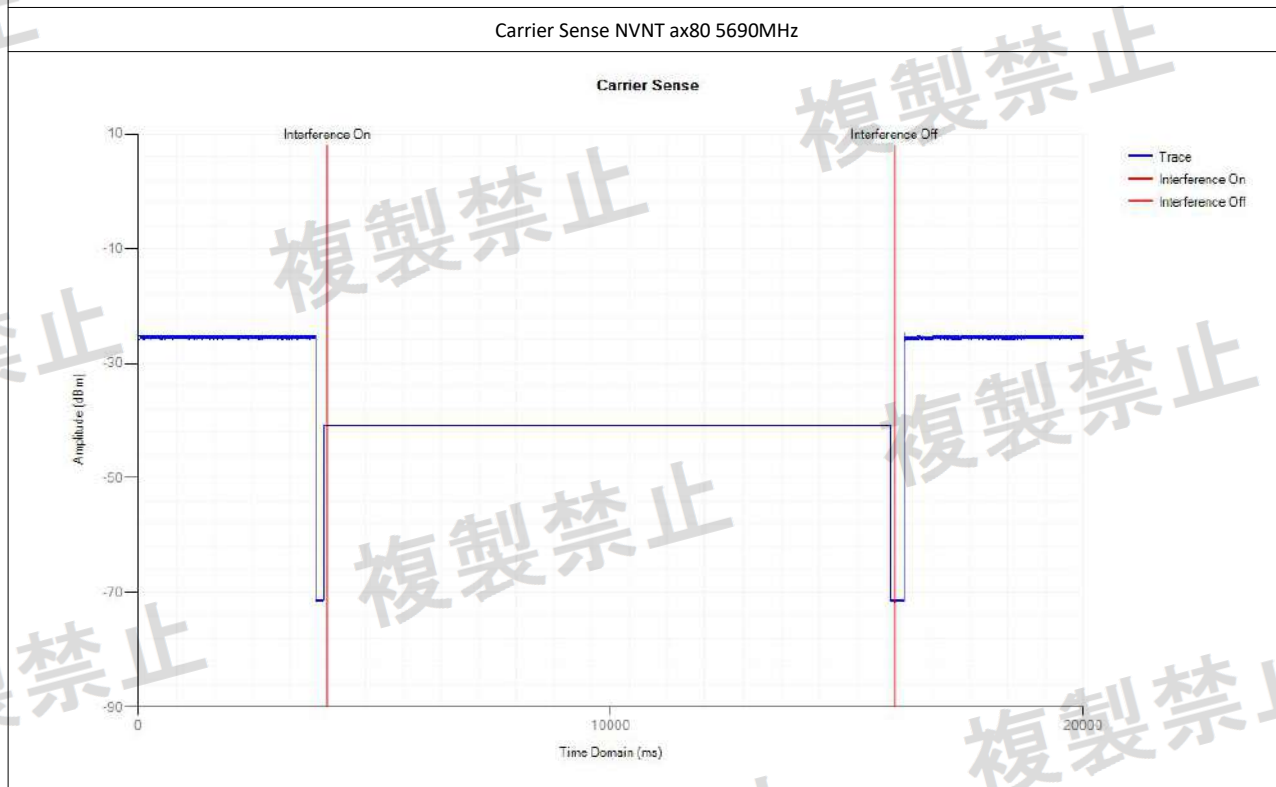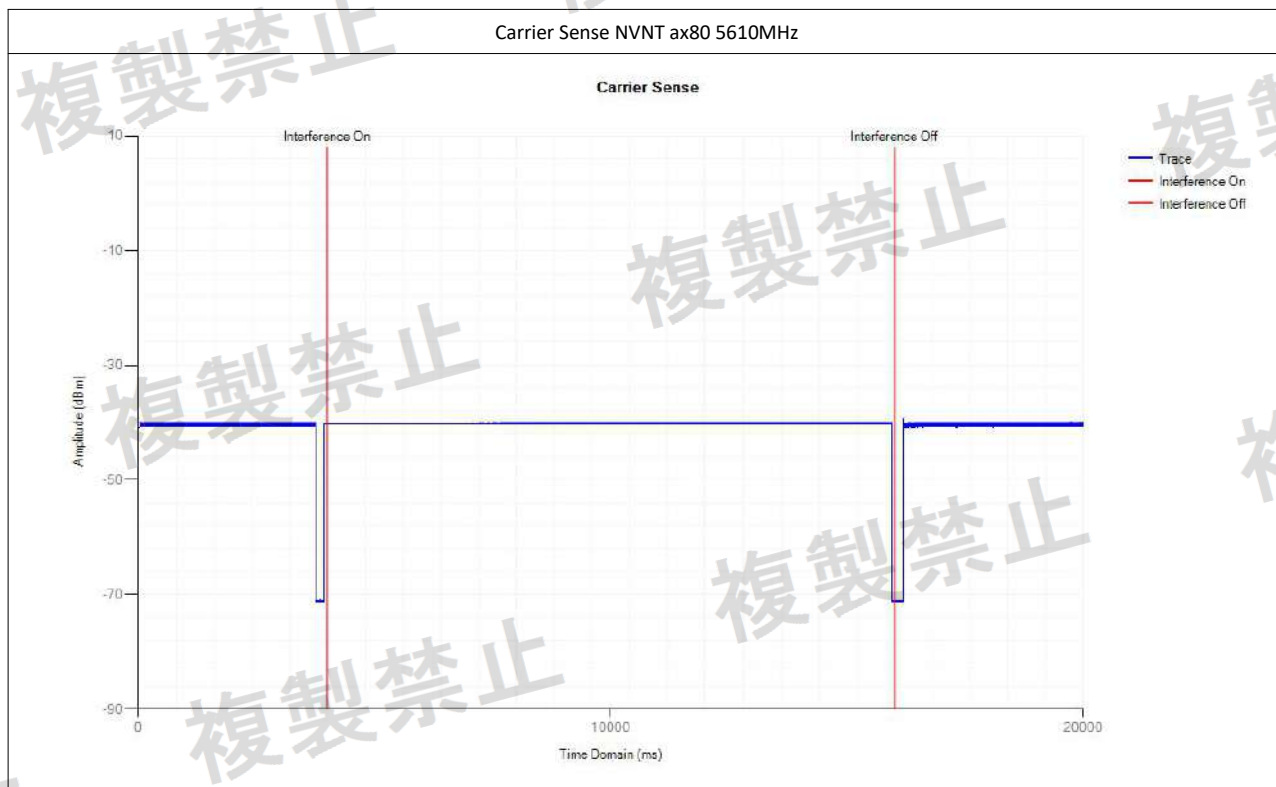


CAC Begin

Mode	Frequency (MHz)	Type	Number	Result	Verdict
ax80	5610	DFS_W53_FP1	1	See test Graph	Pass

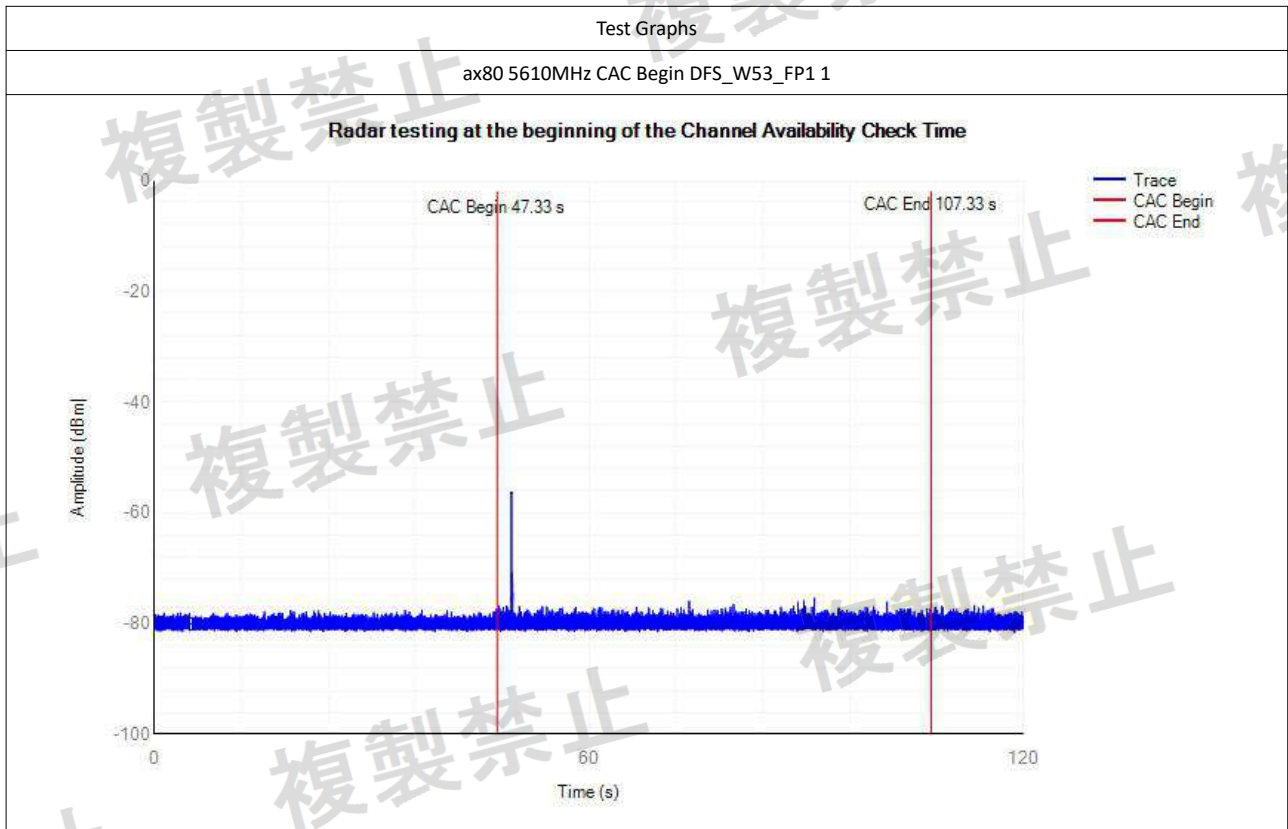


CAC End

Mode	Frequency (MHz)	Type	Number	Result	Verdict
ax80	5610	DFS_W53_FP1	1	See test Graph	Pass

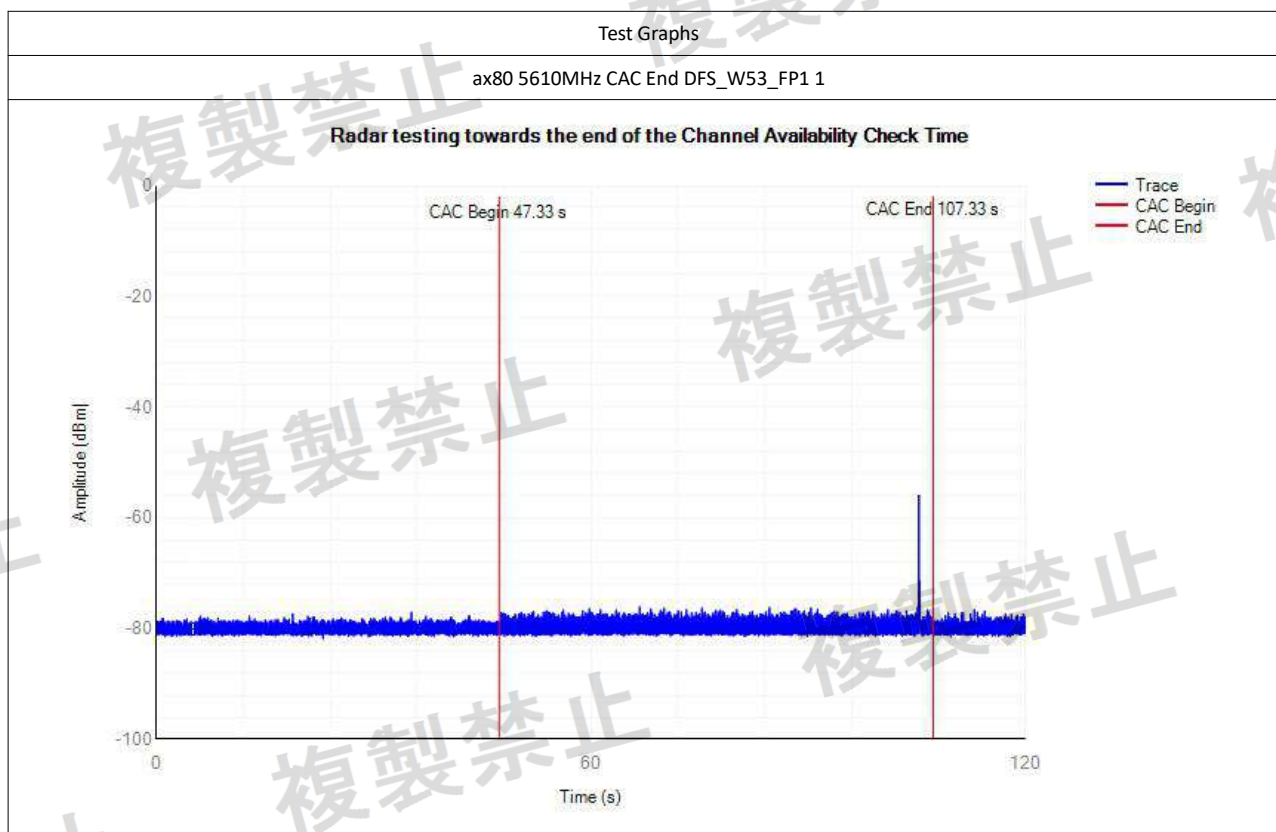


CAC Initial

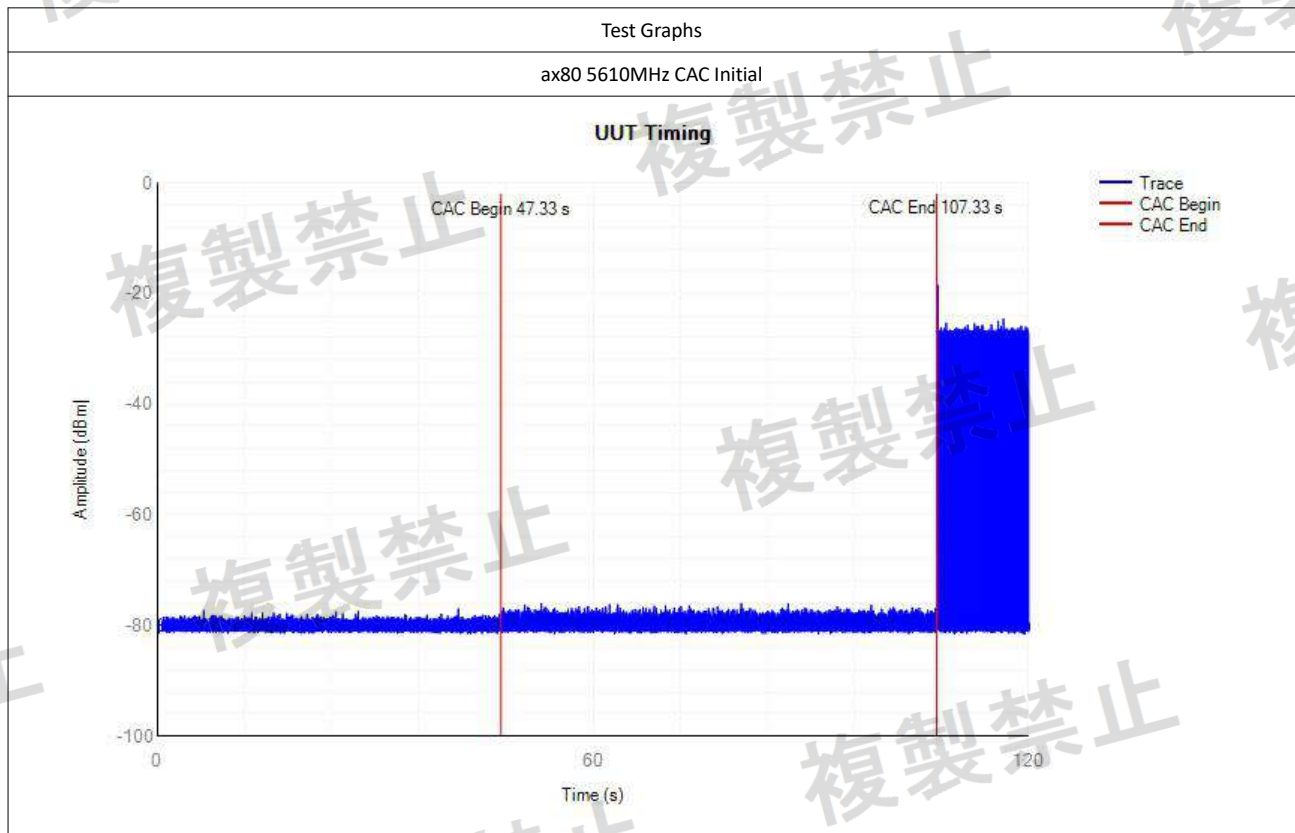

Calibration

Mode	Frequency (MHz)	Type	Result	Verdict
ax80	5610	DFS_W53_FP1	See test Graph	Pass

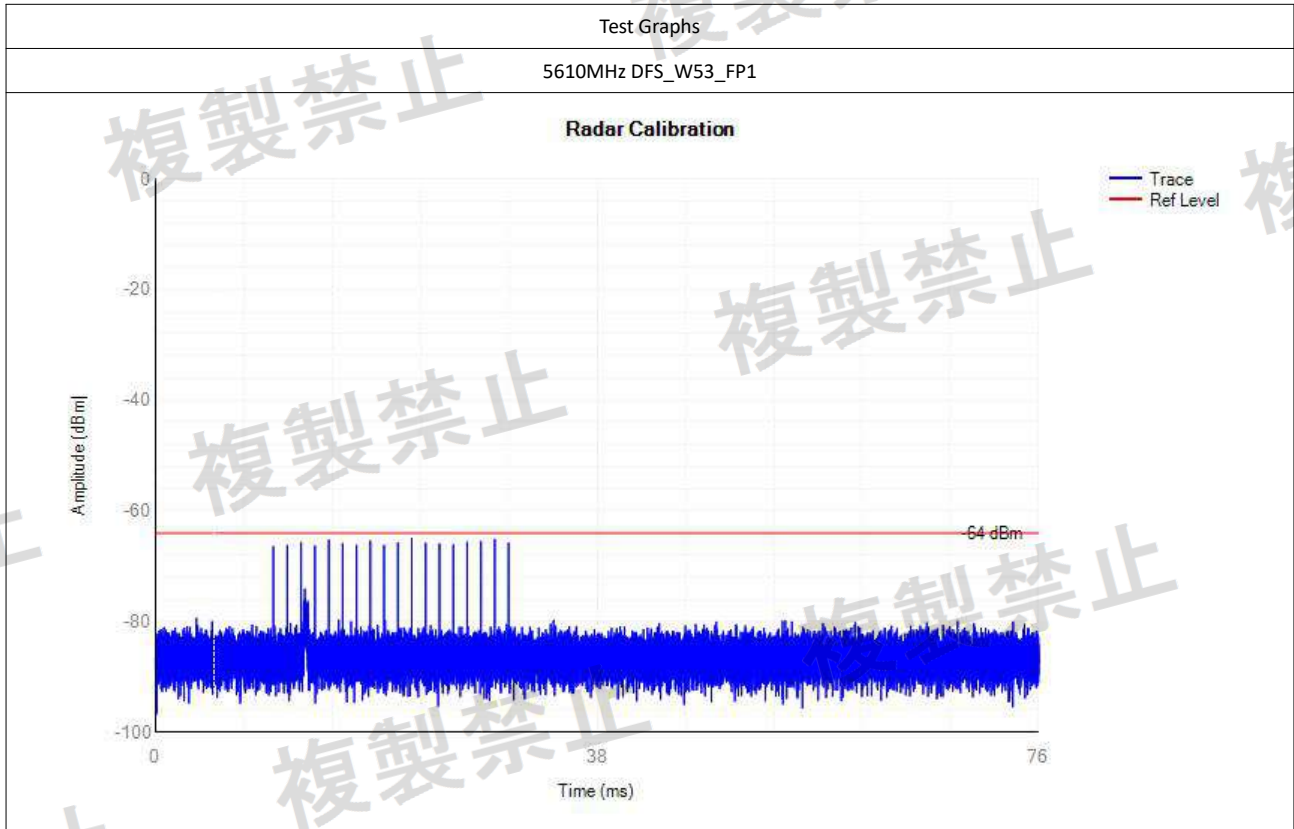




CAC Pd

Mode	Frequency (MHz)	Radar Type	Detection Threshold (dBm)	Total No.	Detected No.	Detection Rate (%)	Limit (%)	Verdict
ax80	5610	W56_FP1	-60	2	2	100	60	Pass
ax80	5610	W56_FP2	-60	5	5	100	60	Pass
ax80	5610	W56_FP3	-60	7	7	100	60	Pass
ax80	5610	W56_WP4	-60	8	8	100	60	Pass
ax80	5610	W56_WP5	-60	10	10	100	60	Pass
ax80	5610	W56_WP6	-60	15	15	100	60	Pass
ax80	5610	W56_Chirp	-60	17	17	100	60	Pass
ax80	5610	W56_Hop	-60	19	19	100	60	Pass

Non-Occupancy

Mode	Frequency (MHz)	Result	Verdict
ax80	5610	See test Graph	Pass

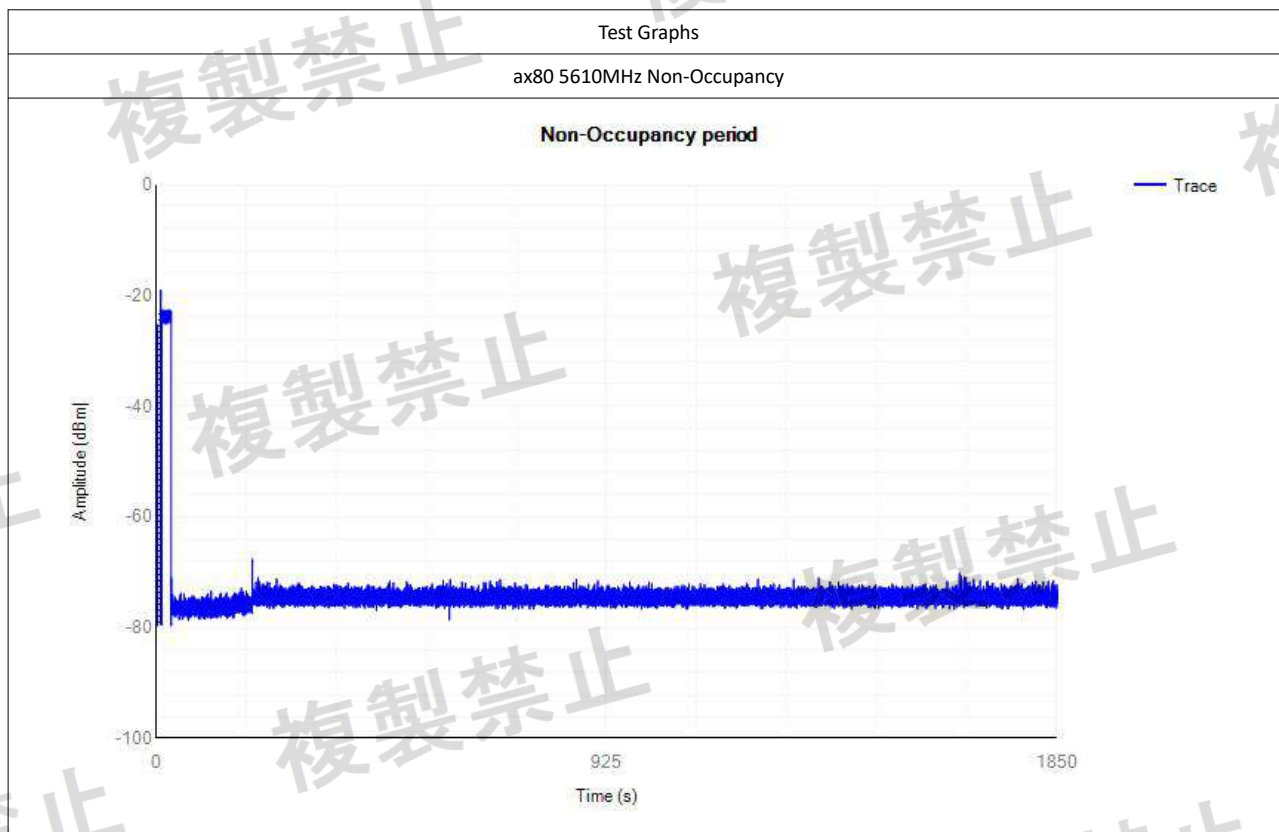

Shutdown Time

Mode	Frequency (MHz)	Channel Move Time (s)	Limit Channel Move Time (s)	Close Transmission Time (s)	Limit Close Transmission Time (s)	Verdict
ax80	5610	0.1726	10	0.0056	0.26	Pass

