



NVNT	n20	5240	Ant2	1000-26000	6978.55	-75.06	-47	Pass
NVNT	n20	5260	Ant1	30-1000	935.55	-88.05	-54	Pass
NVNT	n20	5260	Ant1	1000-26000	15587.43	-74.13	-47	Pass
NVNT	n20	5260	Ant2	30-1000	400.06	-89.61	-54	Pass
NVNT	n20	5260	Ant2	1000-26000	6898.55	-75.03	-47	Pass
NVNT	n20	5280	Ant1	30-1000	981.84	-88.58	-54	Pass
NVNT	n20	5280	Ant1	1000-26000	15540.77	-73.79	-47	Pass
NVNT	n20	5280	Ant2	30-1000	888.92	-89.72	-54	Pass
NVNT	n20	5280	Ant2	1000-26000	15592.43	-74.75	-47	Pass
NVNT	n20	5320	Ant1	30-1000	763.28	-88.51	-54	Pass
NVNT	n20	5320	Ant1	1000-26000	19962.28	-72.76	-47	Pass
NVNT	n20	5320	Ant2	30-1000	620.86	-90.07	-54	Pass
NVNT	n20	5320	Ant2	1000-26000	19883.95	-74.63	-47	Pass
NVNT	n20	5500	Ant1	30-1000	953.04	-87.34	-54	Pass
NVNT	n20	5500	Ant1	1000-26000	15571.6	-73.37	-47	Pass
NVNT	n20	5500	Ant2	30-1000	526.45	-89.7	-54	Pass
NVNT	n20	5500	Ant2	1000-26000	15583.26	-74.14	-47	Pass
NVNT	n20	5600	Ant1	30-1000	356.48	-87.67	-54	Pass
NVNT	n20	5600	Ant1	1000-26000	15584.1	-73.38	-47	Pass
NVNT	n20	5600	Ant2	30-1000	894.13	-89.23	-54	Pass
NVNT	n20	5600	Ant2	1000-26000	15501.6	-74.17	-47	Pass
NVNT	n20	5720	Ant1	30-1000	902.89	-87.81	-54	Pass
NVNT	n20	5720	Ant1	1000-26000	15577.43	-72.15	-47	Pass
NVNT	n20	5720	Ant2	30-1000	306.43	-89.75	-54	Pass
NVNT	n20	5720	Ant2	1000-26000	19997.28	-73.06	-47	Pass
NVNT	n40	5190	Ant1	30-1000	963.74	-88.62	-54	Pass
NVNT	n40	5190	Ant1	1000-26000	19827.29	-73.52	-47	Pass
NVNT	n40	5190	Ant2	30-1000	599	-89.41	-54	Pass
NVNT	n40	5190	Ant2	1000-26000	6686.89	-75.07	-47	Pass
NVNT	n40	5230	Ant1	30-1000	741.52	-88.96	-54	Pass
NVNT	n40	5230	Ant1	1000-26000	6997.72	-73.51	-47	Pass
NVNT	n40	5230	Ant2	30-1000	933.44	-90.07	-54	Pass
NVNT	n40	5230	Ant2	1000-26000	6780.22	-75.16	-47	Pass
NVNT	n40	5270	Ant1	30-1000	898.62	-88.53	-54	Pass
NVNT	n40	5270	Ant1	1000-26000	15598.26	-74.18	-47	Pass
NVNT	n40	5270	Ant2	30-1000	869.3	-90.1	-54	Pass
NVNT	n40	5270	Ant2	1000-26000	15557.43	-74.94	-47	Pass
NVNT	n40	5310	Ant1	30-1000	966.81	-88.97	-54	Pass
NVNT	n40	5310	Ant1	1000-26000	6890.22	-74	-47	Pass
NVNT	n40	5310	Ant2	30-1000	997.56	-89.49	-54	Pass
NVNT	n40	5310	Ant2	1000-26000	19988.95	-74.36	-47	Pass
NVNT	n40	5510	Ant1	30-1000	963.32	-88.81	-54	Pass
NVNT	n40	5510	Ant1	1000-26000	6984.38	-73.36	-47	Pass
NVNT	n40	5510	Ant2	30-1000	895.97	-89.38	-54	Pass
NVNT	n40	5510	Ant2	1000-26000	6985.22	-73.25	-47	Pass
NVNT	n40	5590	Ant1	30-1000	915.99	-88.43	-54	Pass
NVNT	n40	5590	Ant1	1000-26000	15544.93	-73.51	-47	Pass
NVNT	n40	5590	Ant2	30-1000	924.97	-89.33	-54	Pass



NVNT	n40	5590	Ant2	1000-26000	15570.76	-74.35	-47	Pass
NVNT	n40	5710	Ant1	30-1000	984.98	-87.58	-54	Pass
NVNT	n40	5710	Ant1	1000-26000	6902.72	-73.58	-47	Pass
NVNT	n40	5710	Ant2	30-1000	974.54	-89.47	-54	Pass
NVNT	n40	5710	Ant2	1000-26000	6970.22	-74.18	-47	Pass
NVNT	ac20	5180	Ant1	30-1000	469.48	-89.34	-54	Pass
NVNT	ac20	5180	Ant1	1000-26000	6940.22	-74.21	-47	Pass
NVNT	ac20	5180	Ant2	30-1000	898.33	-90.11	-54	Pass
NVNT	ac20	5180	Ant2	1000-26000	15570.76	-74.54	-47	Pass
NVNT	ac20	5200	Ant1	30-1000	766.42	-88.72	-54	Pass
NVNT	ac20	5200	Ant1	1000-26000	19943.95	-73.74	-47	Pass
NVNT	ac20	5200	Ant2	30-1000	234.26	-90.33	-54	Pass
NVNT	ac20	5200	Ant2	1000-26000	15606.6	-74.76	-47	Pass
NVNT	ac20	5240	Ant1	30-1000	844.72	-88.23	-54	Pass
NVNT	ac20	5240	Ant1	1000-26000	15574.93	-73.85	-47	Pass
NVNT	ac20	5240	Ant2	30-1000	876.9	-90.03	-54	Pass
NVNT	ac20	5240	Ant2	1000-26000	15578.26	-75.24	-47	Pass
NVNT	ac20	5260	Ant1	30-1000	901.73	-88.94	-54	Pass
NVNT	ac20	5260	Ant1	1000-26000	19998.95	-73.99	-47	Pass
NVNT	ac20	5260	Ant2	30-1000	885.27	-89.97	-54	Pass
NVNT	ac20	5260	Ant2	1000-26000	15564.1	-74.65	-47	Pass
NVNT	ac20	5280	Ant1	30-1000	892.87	-88.26	-54	Pass
NVNT	ac20	5280	Ant1	1000-26000	19958.12	-73.85	-47	Pass
NVNT	ac20	5280	Ant2	30-1000	993.1	-90	-54	Pass
NVNT	ac20	5280	Ant2	1000-26000	15549.1	-74.21	-47	Pass
NVNT	ac20	5320	Ant1	30-1000	925.52	-88.93	-54	Pass
NVNT	ac20	5320	Ant1	1000-26000	6905.22	-73.61	-47	Pass
NVNT	ac20	5320	Ant2	30-1000	881.2	-89.1	-54	Pass
NVNT	ac20	5320	Ant2	1000-26000	17628.2	-74.84	-47	Pass
NVNT	ac20	5500	Ant1	30-1000	994.75	-87.9	-54	Pass
NVNT	ac20	5500	Ant1	1000-26000	20013.95	-73.03	-47	Pass
NVNT	ac20	5500	Ant2	30-1000	981.33	-89.32	-54	Pass
NVNT	ac20	5500	Ant2	1000-26000	20001.45	-74.05	-47	Pass
NVNT	ac20	5600	Ant1	30-1000	928.82	-88.64	-54	Pass
NVNT	ac20	5600	Ant1	1000-26000	6966.05	-72.58	-47	Pass
NVNT	ac20	5600	Ant2	30-1000	938.97	-89.08	-54	Pass
NVNT	ac20	5600	Ant2	1000-26000	20006.45	-74.98	-47	Pass
NVNT	ac20	5720	Ant1	30-1000	580.44	-88.93	-54	Pass
NVNT	ac20	5720	Ant1	1000-26000	19983.95	-73.16	-47	Pass
NVNT	ac20	5720	Ant2	30-1000	997.66	-89.5	-54	Pass
NVNT	ac20	5720	Ant2	1000-26000	15575.76	-74.76	-47	Pass
NVNT	ac40	5190	Ant1	30-1000	141.37	-88.79	-54	Pass
NVNT	ac40	5190	Ant1	1000-26000	15599.1	-73.69	-47	Pass
NVNT	ac40	5190	Ant2	30-1000	921	-90.24	-54	Pass
NVNT	ac40	5190	Ant2	1000-26000	15565.76	-74.74	-47	Pass
NVNT	ac40	5230	Ant1	30-1000	922.13	-88.76	-54	Pass
NVNT	ac40	5230	Ant1	1000-26000	20001.45	-72.51	-47	Pass
NVNT	ac40	5230	Ant2	30-1000	660.37	-89.79	-54	Pass




NVNT	ac40	5230	Ant2	1000-26000	19891.45	-74.79	-47	Pass
NVNT	ac40	5270	Ant1	30-1000	821.41	-89.23	-54	Pass
NVNT	ac40	5270	Ant1	1000-26000	6776.89	-73.43	-47	Pass
NVNT	ac40	5270	Ant2	30-1000	930.34	-89.56	-54	Pass
NVNT	ac40	5270	Ant2	1000-26000	19943.12	-74.99	-47	Pass
NVNT	ac40	5310	Ant1	30-1000	924.29	-89.01	-54	Pass
NVNT	ac40	5310	Ant1	1000-26000	6991.88	-72.43	-47	Pass
NVNT	ac40	5310	Ant2	30-1000	726.29	-89.66	-54	Pass
NVNT	ac40	5310	Ant2	1000-26000	15583.26	-75.56	-47	Pass
NVNT	ac40	5510	Ant1	30-1000	904.96	-88.52	-54	Pass
NVNT	ac40	5510	Ant1	1000-26000	15598.26	-73.4	-47	Pass
NVNT	ac40	5510	Ant2	30-1000	888.11	-89.13	-54	Pass
NVNT	ac40	5510	Ant2	1000-26000	15588.26	-73.97	-47	Pass
NVNT	ac40	5590	Ant1	30-1000	961.7	-88.13	-54	Pass
NVNT	ac40	5590	Ant1	1000-26000	6991.05	-73.5	-47	Pass
NVNT	ac40	5590	Ant2	30-1000	664.76	-89.14	-54	Pass
NVNT	ac40	5590	Ant2	1000-26000	19993.95	-74.22	-47	Pass
NVNT	ac40	5710	Ant1	30-1000	867.1	-88.02	-54	Pass
NVNT	ac40	5710	Ant1	1000-26000	6911.89	-73.01	-47	Pass
NVNT	ac40	5710	Ant2	30-1000	985.11	-89.74	-54	Pass
NVNT	ac40	5710	Ant2	1000-26000	19887.29	-74.69	-47	Pass
NVNT	ac80	5210	Ant1	30-1000	897.26	-88.77	-54	Pass
NVNT	ac80	5210	Ant1	1000-26000	15560.76	-73.98	-47	Pass
NVNT	ac80	5210	Ant2	30-1000	847.86	-89.89	-54	Pass
NVNT	ac80	5210	Ant2	1000-26000	15602.43	-74.86	-47	Pass
NVNT	ac80	5290	Ant1	30-1000	914.85	-87.98	-54	Pass
NVNT	ac80	5290	Ant1	1000-26000	15561.6	-73.02	-47	Pass
NVNT	ac80	5290	Ant2	30-1000	899.27	-88.98	-54	Pass
NVNT	ac80	5290	Ant2	1000-26000	20000.62	-74.29	-47	Pass
NVNT	ac80	5530	Ant1	30-1000	637.96	-88.34	-54	Pass
NVNT	ac80	5530	Ant1	1000-26000	15569.93	-73.07	-47	Pass
NVNT	ac80	5530	Ant2	30-1000	941.37	-89.22	-54	Pass
NVNT	ac80	5530	Ant2	1000-26000	19979.78	-74.6	-47	Pass
NVNT	ac80	5610	Ant1	30-1000	952.71	-88.17	-54	Pass
NVNT	ac80	5610	Ant1	1000-26000	15612.43	-73.09	-47	Pass
NVNT	ac80	5610	Ant2	30-1000	969.88	-89.85	-54	Pass
NVNT	ac80	5610	Ant2	1000-26000	6984.38	-74.7	-47	Pass
NVNT	ac80	5690	Ant1	30-1000	834.86	-88.17	-54	Pass
NVNT	ac80	5690	Ant1	1000-26000	6953.55	-73.65	-47	Pass
NVNT	ac80	5690	Ant2	30-1000	834.73	-89.93	-54	Pass
NVNT	ac80	5690	Ant2	1000-26000	15553.26	-74.1	-47	Pass
NVNT	ax20	5180	Ant1	30-1000	933.64	-89.11	-54	Pass
NVNT	ax20	5180	Ant1	1000-26000	19997.28	-73.8	-47	Pass
NVNT	ax20	5180	Ant2	30-1000	796.84	-90.39	-54	Pass
NVNT	ax20	5180	Ant2	1000-26000	6988.55	-74.8	-47	Pass
NVNT	ax20	5200	Ant1	30-1000	957.21	-89.1	-54	Pass
NVNT	ax20	5200	Ant1	1000-26000	6671.06	-73.98	-47	Pass
NVNT	ax20	5200	Ant2	30-1000	909	-89.51	-54	Pass






NVNT	ax20	5200	Ant2	1000-26000	15567.43	-75.03	-47	Pass
NVNT	ax20	5240	Ant1	30-1000	827.23	-88.94	-54	Pass
NVNT	ax20	5240	Ant1	1000-26000	19840.62	-73.62	-47	Pass
NVNT	ax20	5240	Ant2	30-1000	966.71	-89.9	-54	Pass
NVNT	ax20	5240	Ant2	1000-26000	6975.22	-75.13	-47	Pass
NVNT	ax20	5260	Ant1	30-1000	836.22	-88.55	-54	Pass
NVNT	ax20	5260	Ant1	1000-26000	15549.1	-74	-47	Pass
NVNT	ax20	5260	Ant2	30-1000	898.04	-89.99	-54	Pass
NVNT	ax20	5260	Ant2	1000-26000	19993.95	-74.55	-47	Pass
NVNT	ax20	5280	Ant1	30-1000	958.57	-88.31	-54	Pass
NVNT	ax20	5280	Ant1	1000-26000	15568.26	-73.42	-47	Pass
NVNT	ax20	5280	Ant2	30-1000	859.47	-89.43	-54	Pass
NVNT	ax20	5280	Ant2	1000-26000	15576.6	-74.9	-47	Pass
NVNT	ax20	5320	Ant1	30-1000	909.84	-88.76	-54	Pass
NVNT	ax20	5320	Ant1	1000-26000	15590.76	-73.54	-47	Pass
NVNT	ax20	5320	Ant2	30-1000	585.87	-89.92	-54	Pass
NVNT	ax20	5320	Ant2	1000-26000	19906.45	-74.24	-47	Pass
NVNT	ax20	5500	Ant1	30-1000	902.08	-87.72	-54	Pass
NVNT	ax20	5500	Ant1	1000-26000	6926.89	-72.32	-47	Pass
NVNT	ax20	5500	Ant2	30-1000	287.25	-89.9	-54	Pass
NVNT	ax20	5500	Ant2	1000-26000	6836.06	-74.51	-47	Pass
NVNT	ax20	5600	Ant1	30-1000	777.86	-88.21	-54	Pass
NVNT	ax20	5600	Ant1	1000-26000	19991.45	-73.24	-47	Pass
NVNT	ax20	5600	Ant2	30-1000	957.79	-89.32	-54	Pass
NVNT	ax20	5600	Ant2	1000-26000	15558.26	-74.32	-47	Pass
NVNT	ax20	5720	Ant1	30-1000	901.24	-88.16	-54	Pass
NVNT	ax20	5720	Ant1	1000-26000	20020.62	-73.39	-47	Pass
NVNT	ax20	5720	Ant2	30-1000	977.45	-90.06	-54	Pass
NVNT	ax20	5720	Ant2	1000-26000	6926.89	-74.27	-47	Pass
NVNT	ax40	5190	Ant1	30-1000	670.13	-88.97	-54	Pass
NVNT	ax40	5190	Ant1	1000-26000	19987.28	-73.54	-47	Pass
NVNT	ax40	5190	Ant2	30-1000	947.7	-89.71	-54	Pass
NVNT	ax40	5190	Ant2	1000-26000	6384.4	-74.99	-47	Pass
NVNT	ax40	5230	Ant1	30-1000	870.49	-88.83	-54	Pass
NVNT	ax40	5230	Ant1	1000-26000	15597.43	-74.22	-47	Pass
NVNT	ax40	5230	Ant2	30-1000	970.85	-89.64	-54	Pass
NVNT	ax40	5230	Ant2	1000-26000	15582.43	-74.99	-47	Pass
NVNT	ax40	5270	Ant1	30-1000	861.6	-88.66	-54	Pass
NVNT	ax40	5270	Ant1	1000-26000	19371.47	-73.96	-47	Pass
NVNT	ax40	5270	Ant2	30-1000	851.51	-89.47	-54	Pass
NVNT	ax40	5270	Ant2	1000-26000	19851.45	-74.9	-47	Pass
NVNT	ax40	5310	Ant1	30-1000	348.55	-89.04	-54	Pass
NVNT	ax40	5310	Ant1	1000-26000	19992.28	-73.18	-47	Pass
NVNT	ax40	5310	Ant2	30-1000	934.96	-89.7	-54	Pass
NVNT	ax40	5310	Ant2	1000-26000	15597.43	-74.53	-47	Pass
NVNT	ax40	5510	Ant1	30-1000	972.08	-87.77	-54	Pass
NVNT	ax40	5510	Ant1	1000-26000	20020.62	-73.39	-47	Pass
NVNT	ax40	5510	Ant2	30-1000	734.02	-88.66	-54	Pass






NVNT	ax40	5510	Ant2	1000-26000	15587.43	-74.42	-47	Pass
NVNT	ax40	5590	Ant1	30-1000	359.55	-88.53	-54	Pass
NVNT	ax40	5590	Ant1	1000-26000	19994.78	-73.4	-47	Pass
NVNT	ax40	5590	Ant2	30-1000	991.55	-89.12	-54	Pass
NVNT	ax40	5590	Ant2	1000-26000	6997.72	-74.75	-47	Pass
NVNT	ax40	5710	Ant1	30-1000	581.44	-88.24	-54	Pass
NVNT	ax40	5710	Ant1	1000-26000	6887.72	-73.36	-47	Pass
NVNT	ax40	5710	Ant2	30-1000	618.46	-89.51	-54	Pass
NVNT	ax40	5710	Ant2	1000-26000	15575.76	-74.54	-47	Pass
NVNT	ax80	5210	Ant1	30-1000	952.97	-88.59	-54	Pass
NVNT	ax80	5210	Ant1	1000-26000	19996.45	-72.6	-47	Pass
NVNT	ax80	5210	Ant2	30-1000	978.39	-89.43	-54	Pass
NVNT	ax80	5210	Ant2	1000-26000	15569.93	-75.07	-47	Pass
NVNT	ax80	5290	Ant1	30-1000	475.13	-88.63	-54	Pass
NVNT	ax80	5290	Ant1	1000-26000	15579.1	-73.85	-47	Pass
NVNT	ax80	5290	Ant2	30-1000	985.92	-88.78	-54	Pass
NVNT	ax80	5290	Ant2	1000-26000	15576.6	-74.44	-47	Pass
NVNT	ax80	5530	Ant1	30-1000	699.81	-88.81	-54	Pass
NVNT	ax80	5530	Ant1	1000-26000	15555.76	-73.79	-47	Pass
NVNT	ax80	5530	Ant2	30-1000	900.3	-89.72	-54	Pass
NVNT	ax80	5530	Ant2	1000-26000	15601.6	-74.57	-47	Pass
NVNT	ax80	5610	Ant1	30-1000	326.99	-88.73	-54	Pass
NVNT	ax80	5610	Ant1	1000-26000	6949.39	-73.56	-47	Pass
NVNT	ax80	5610	Ant2	30-1000	974.96	-89.79	-54	Pass
NVNT	ax80	5610	Ant2	1000-26000	19948.95	-74.59	-47	Pass
NVNT	ax80	5690	Ant1	30-1000	957.56	-88.06	-54	Pass
NVNT	ax80	5690	Ant1	1000-26000	15570.76	-73.83	-47	Pass
NVNT	ax80	5690	Ant2	30-1000	458.13	-89.5	-54	Pass
NVNT	ax80	5690	Ant2	1000-26000	15553.26	-73.97	-47	Pass


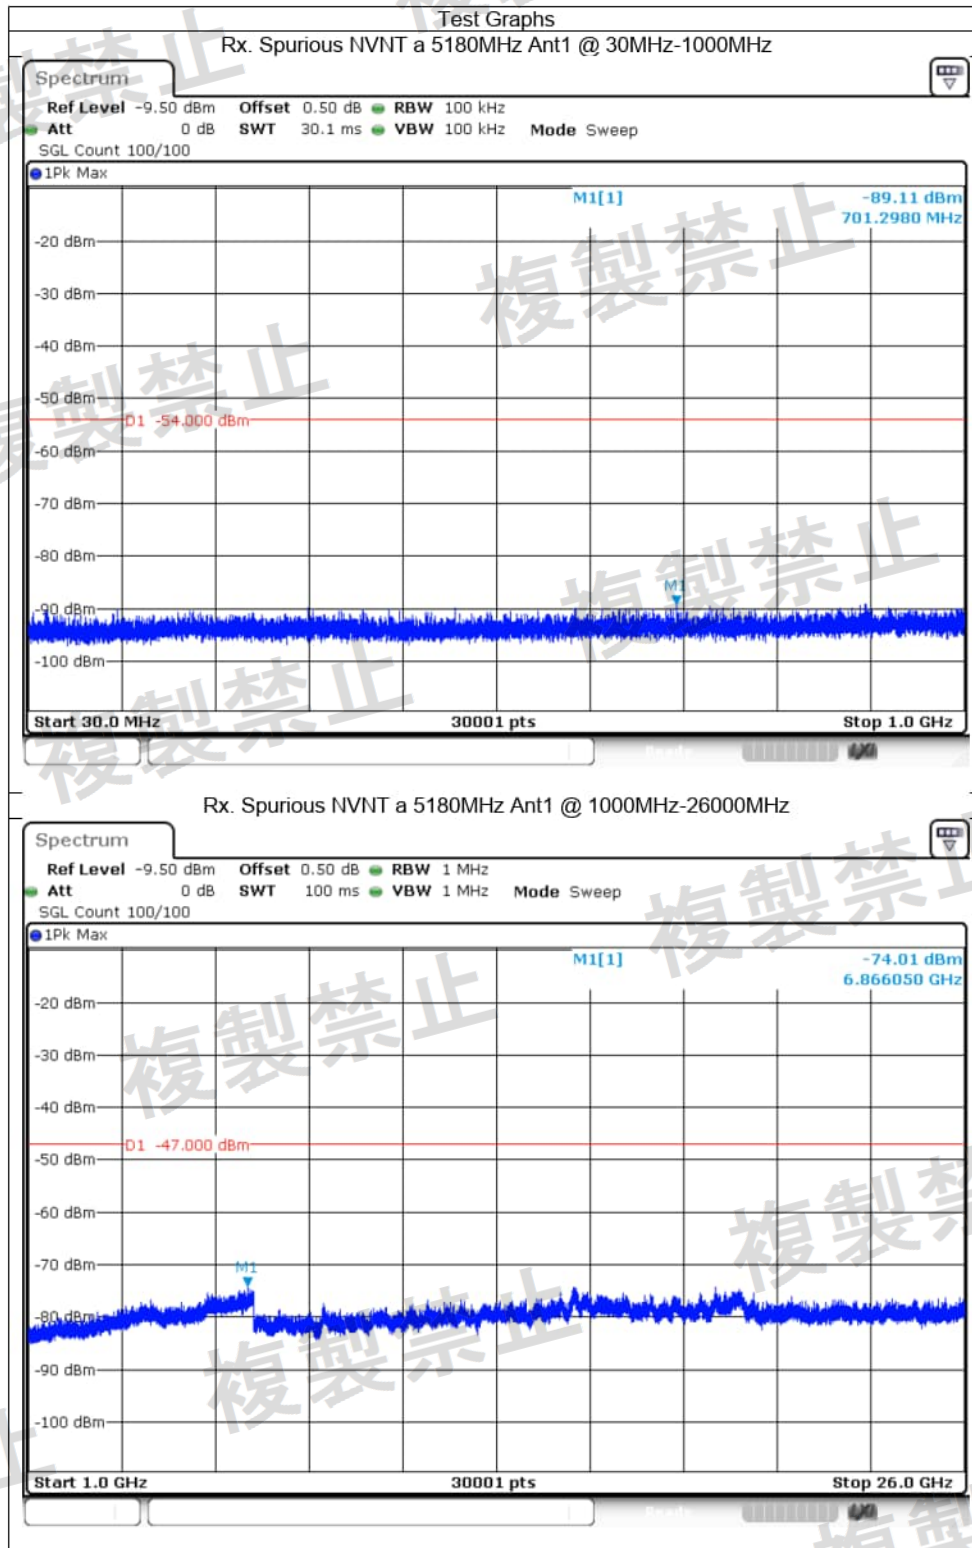



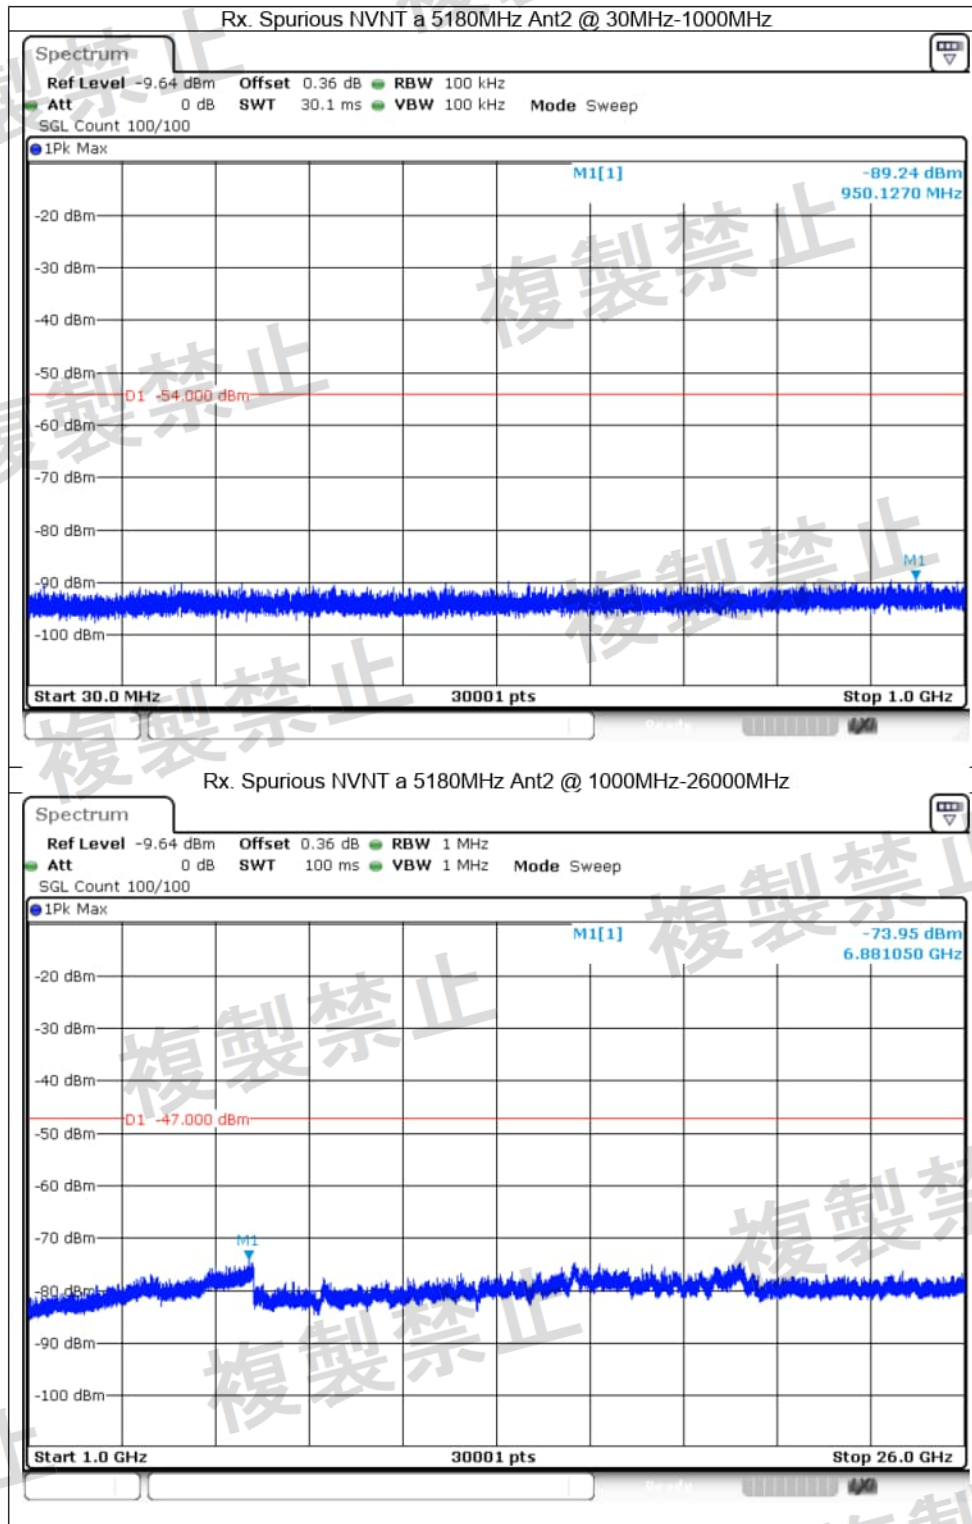


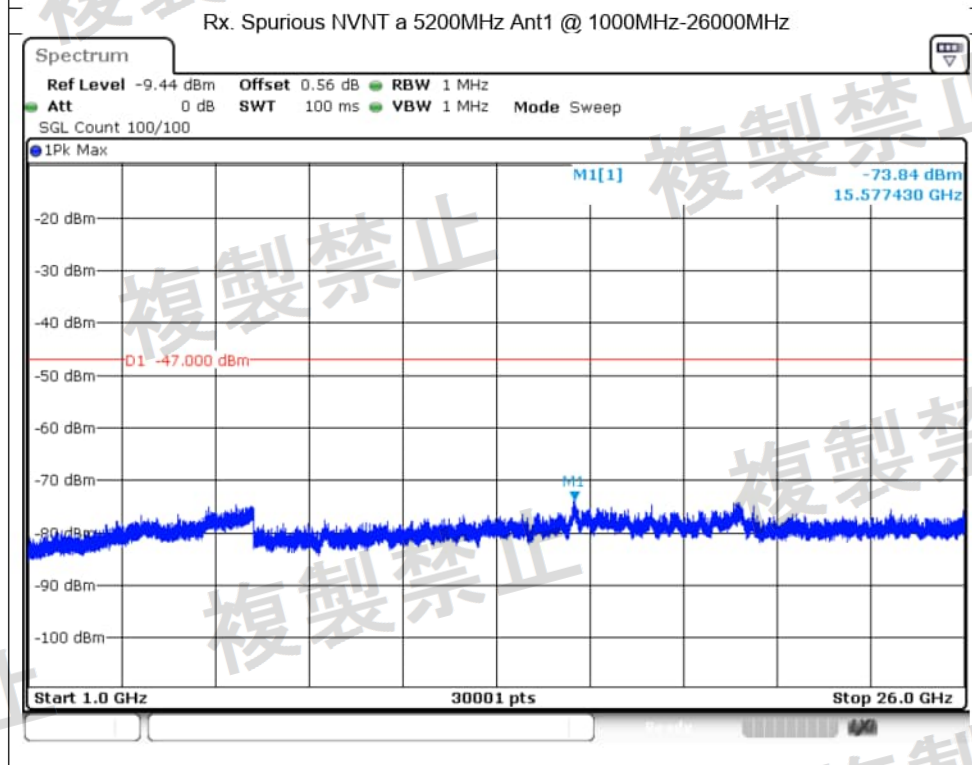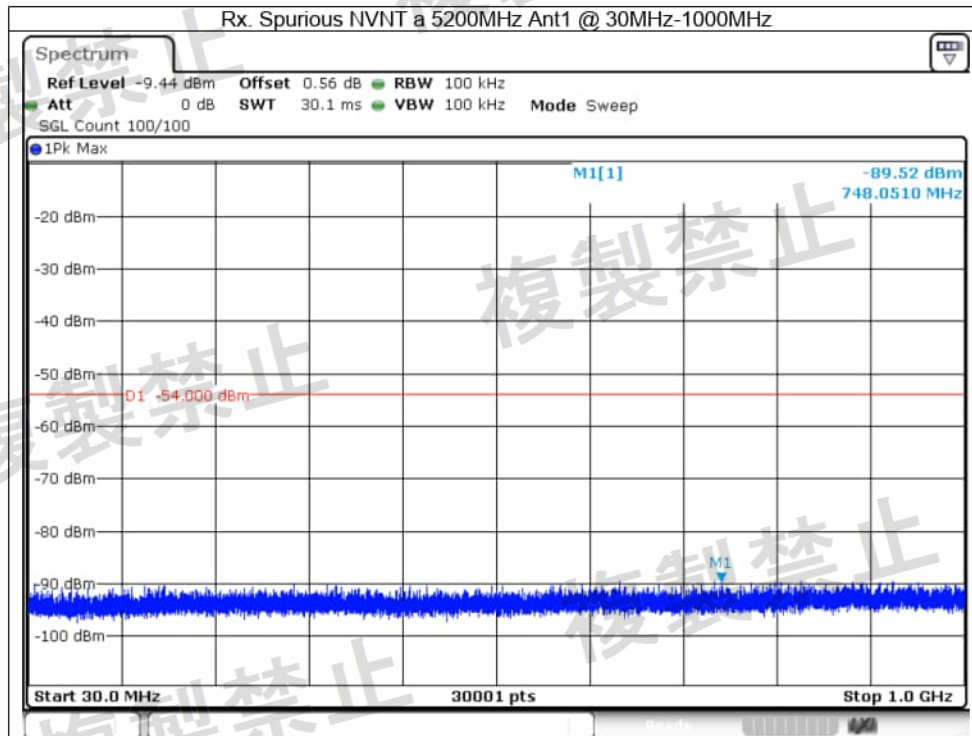



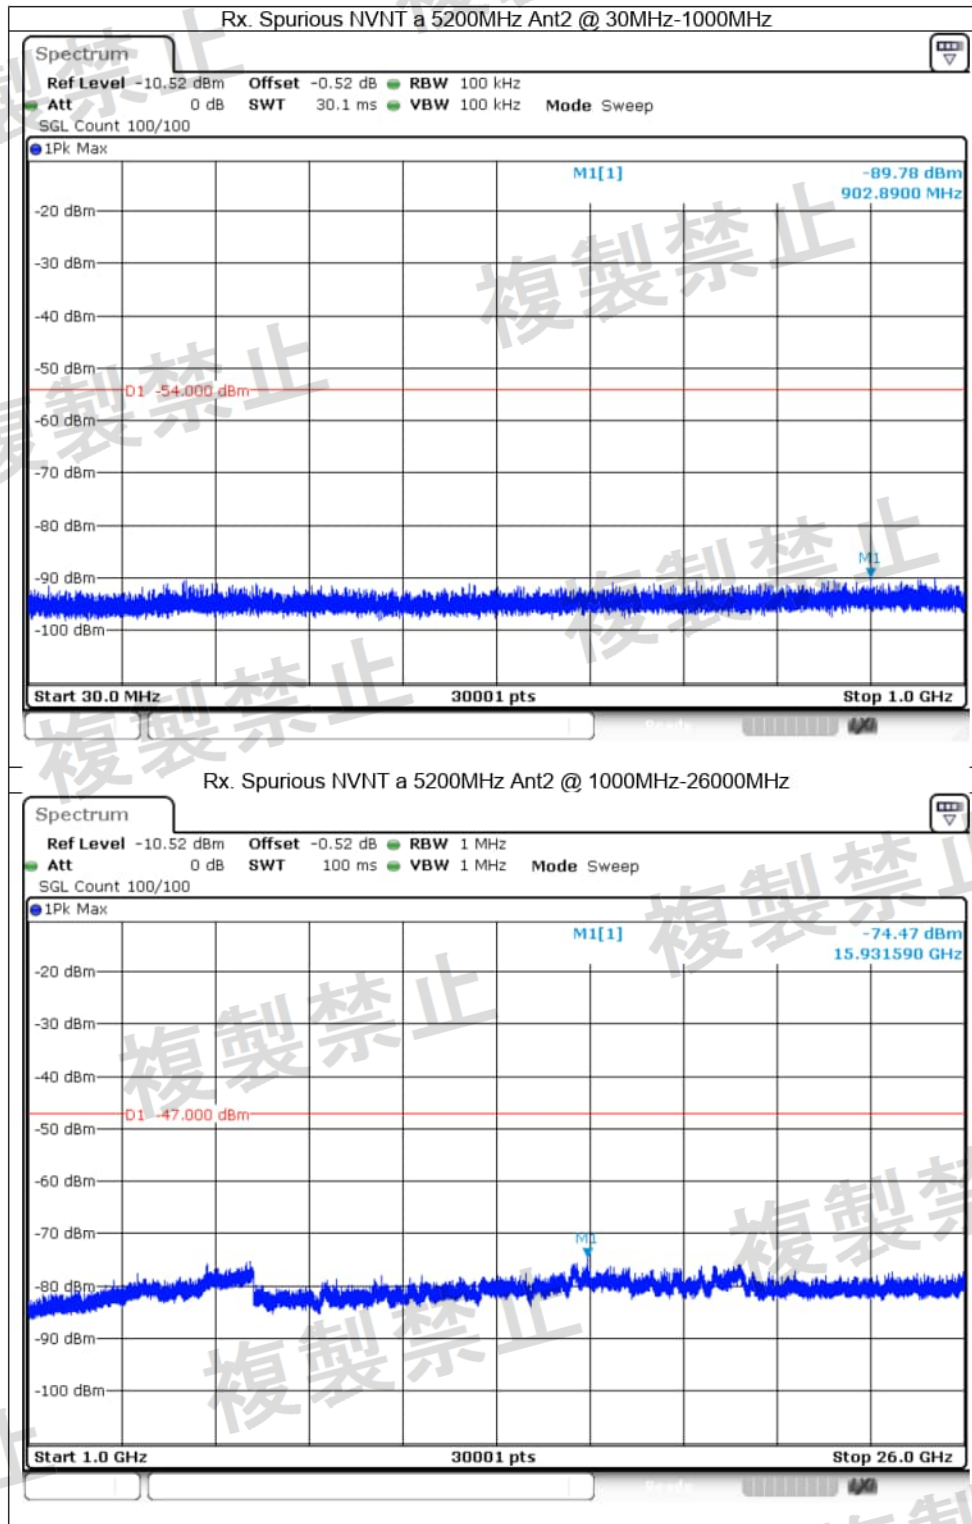


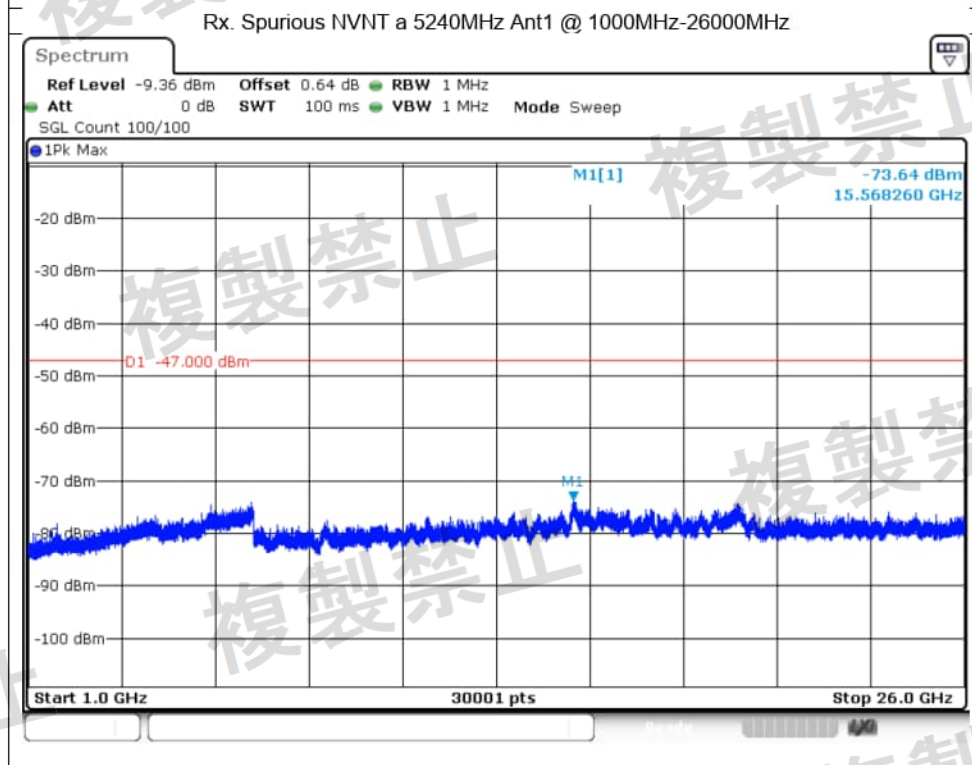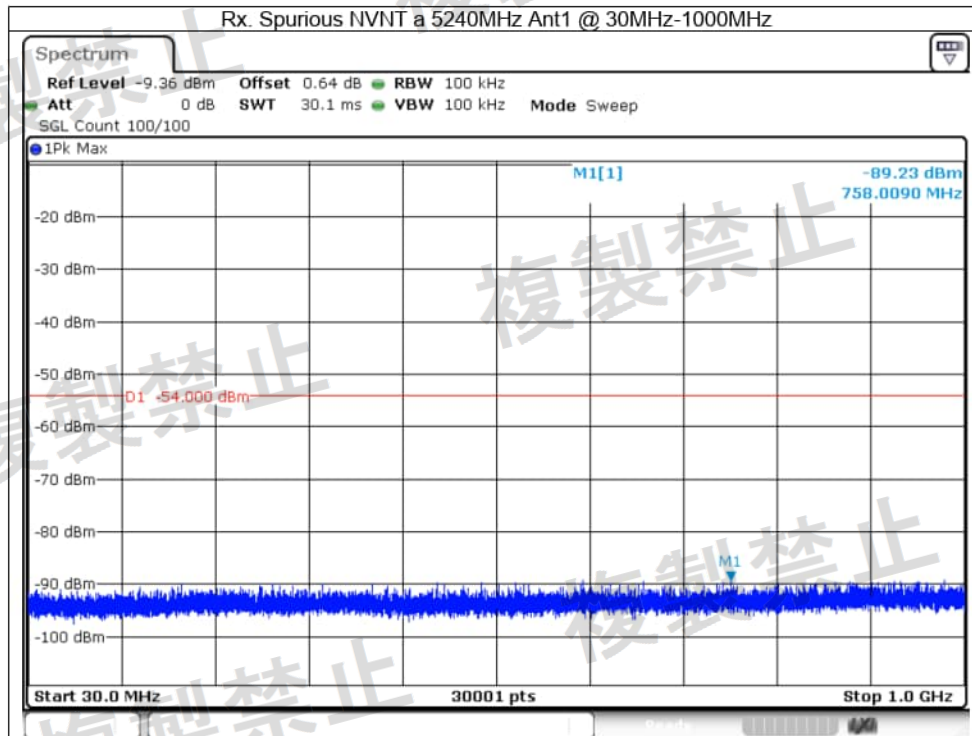


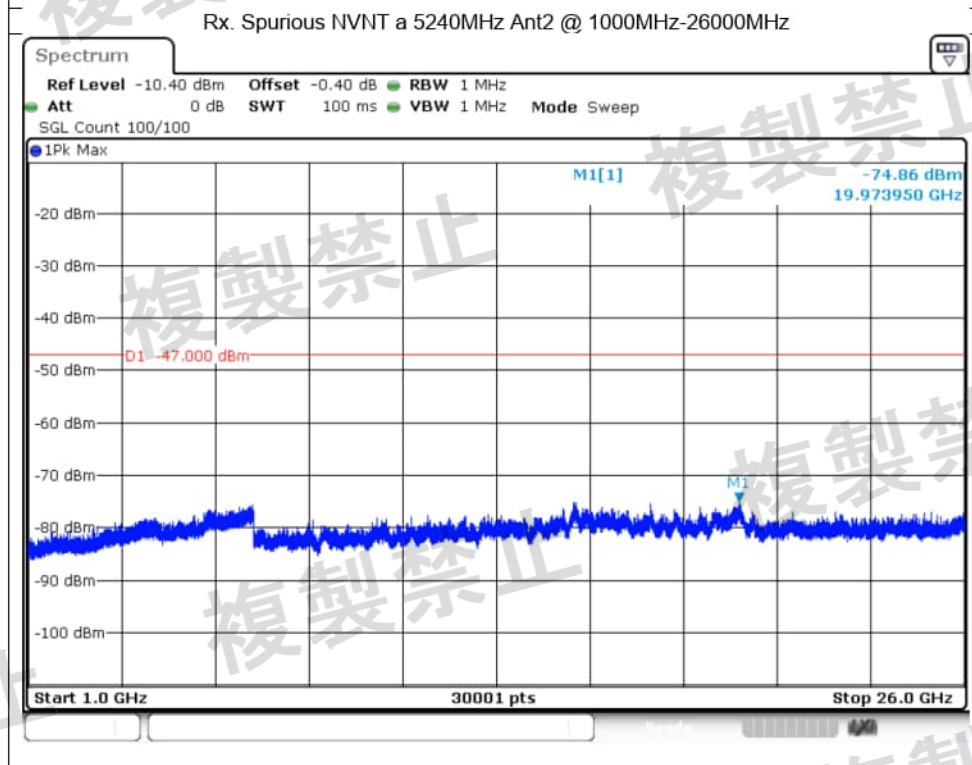
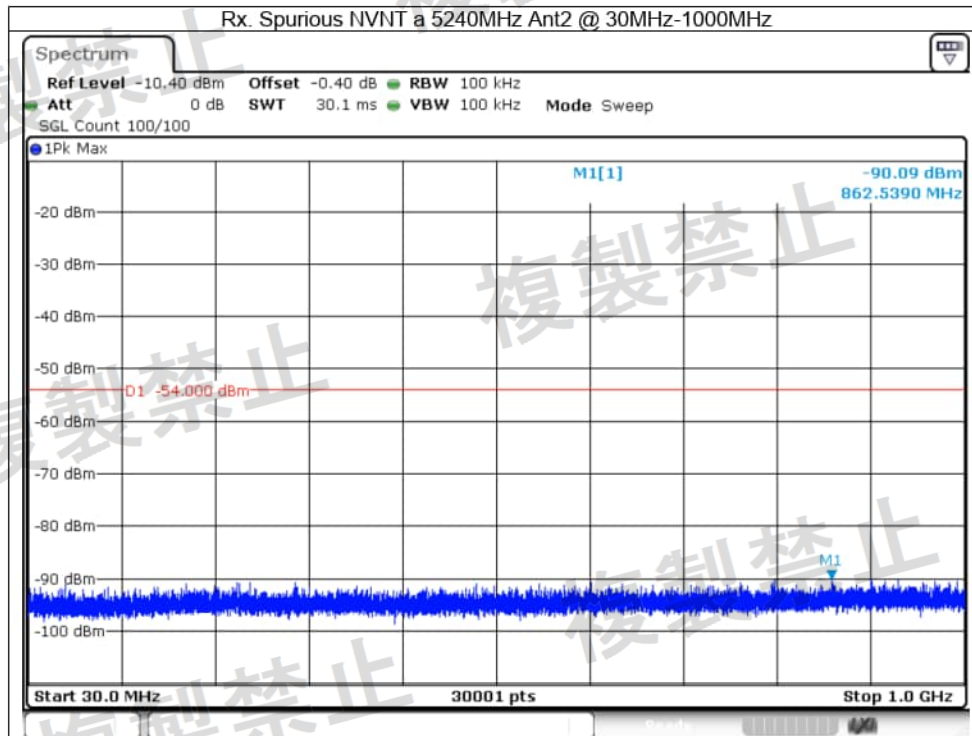


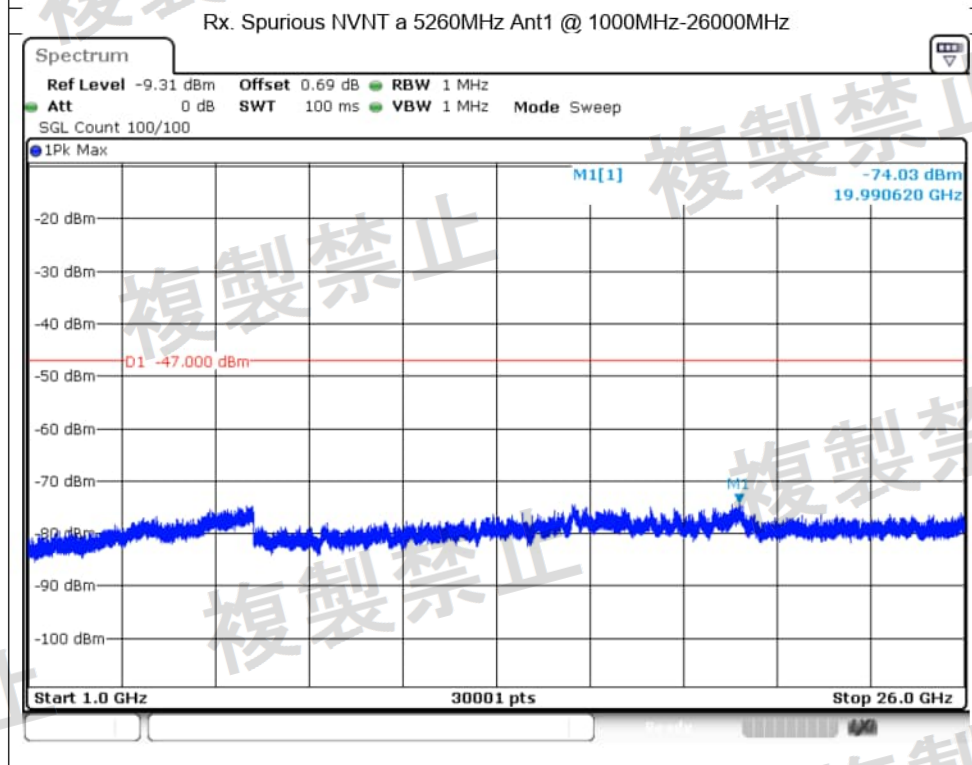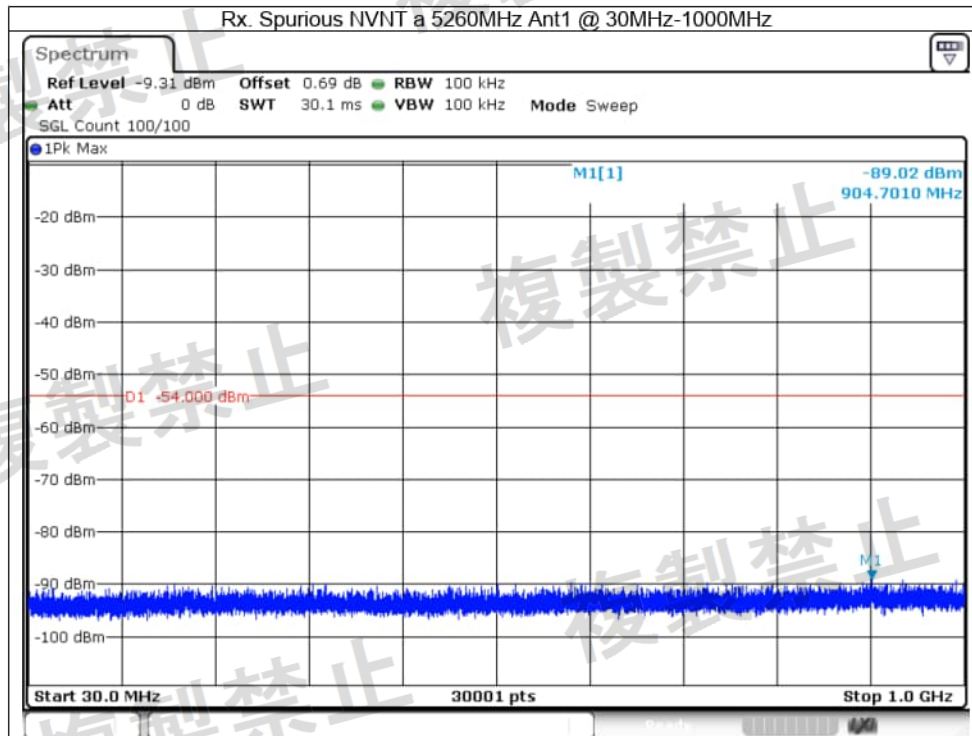



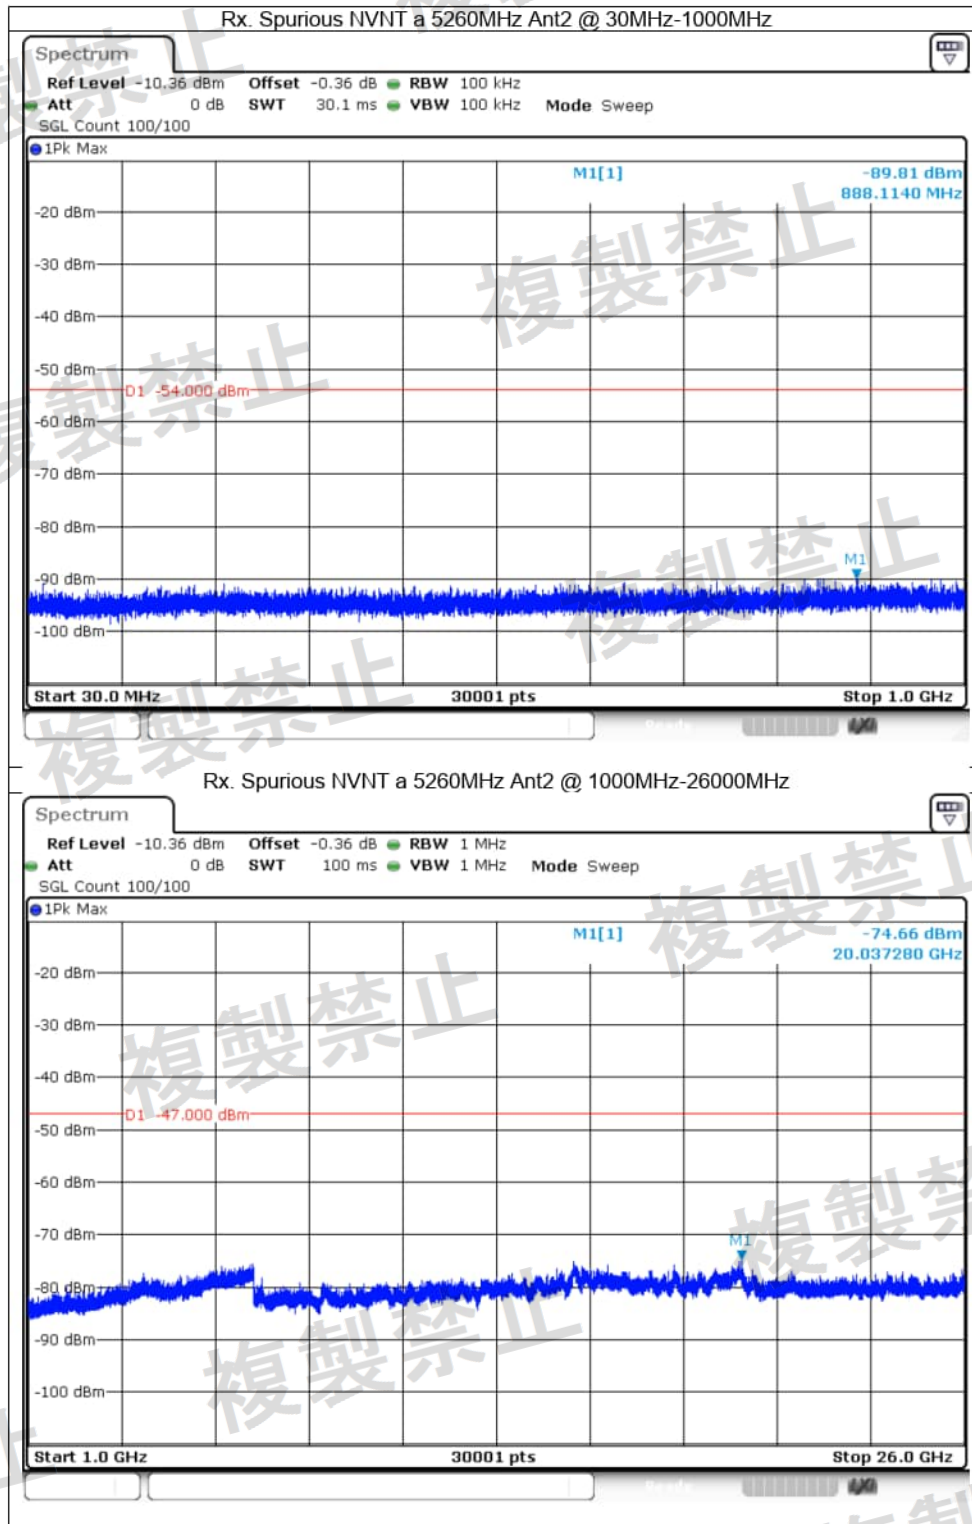


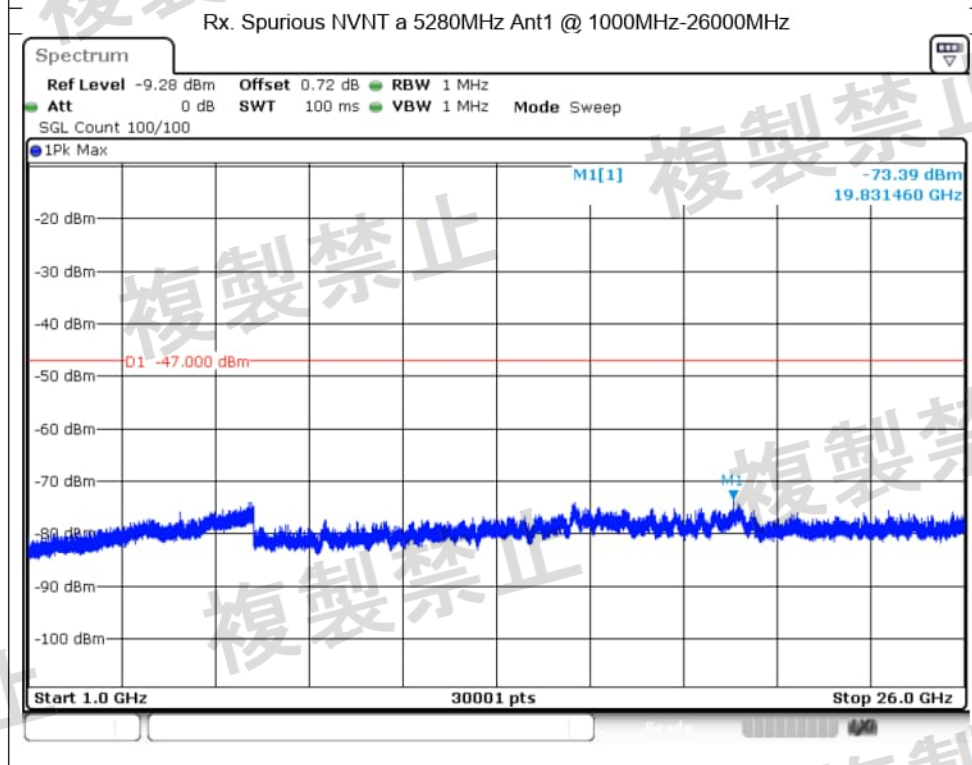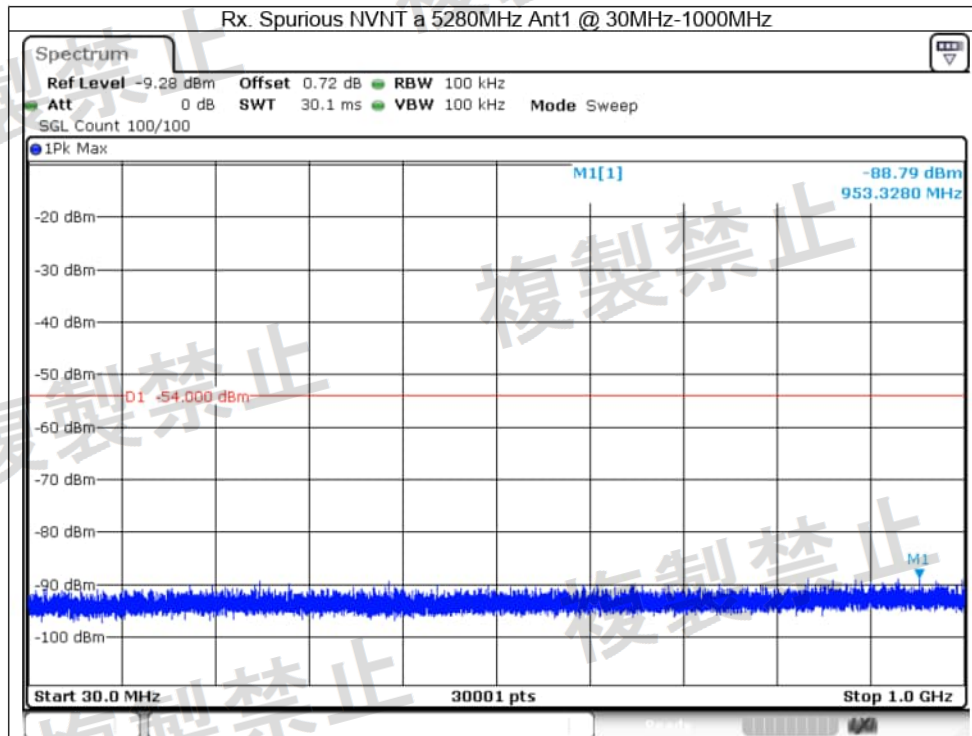



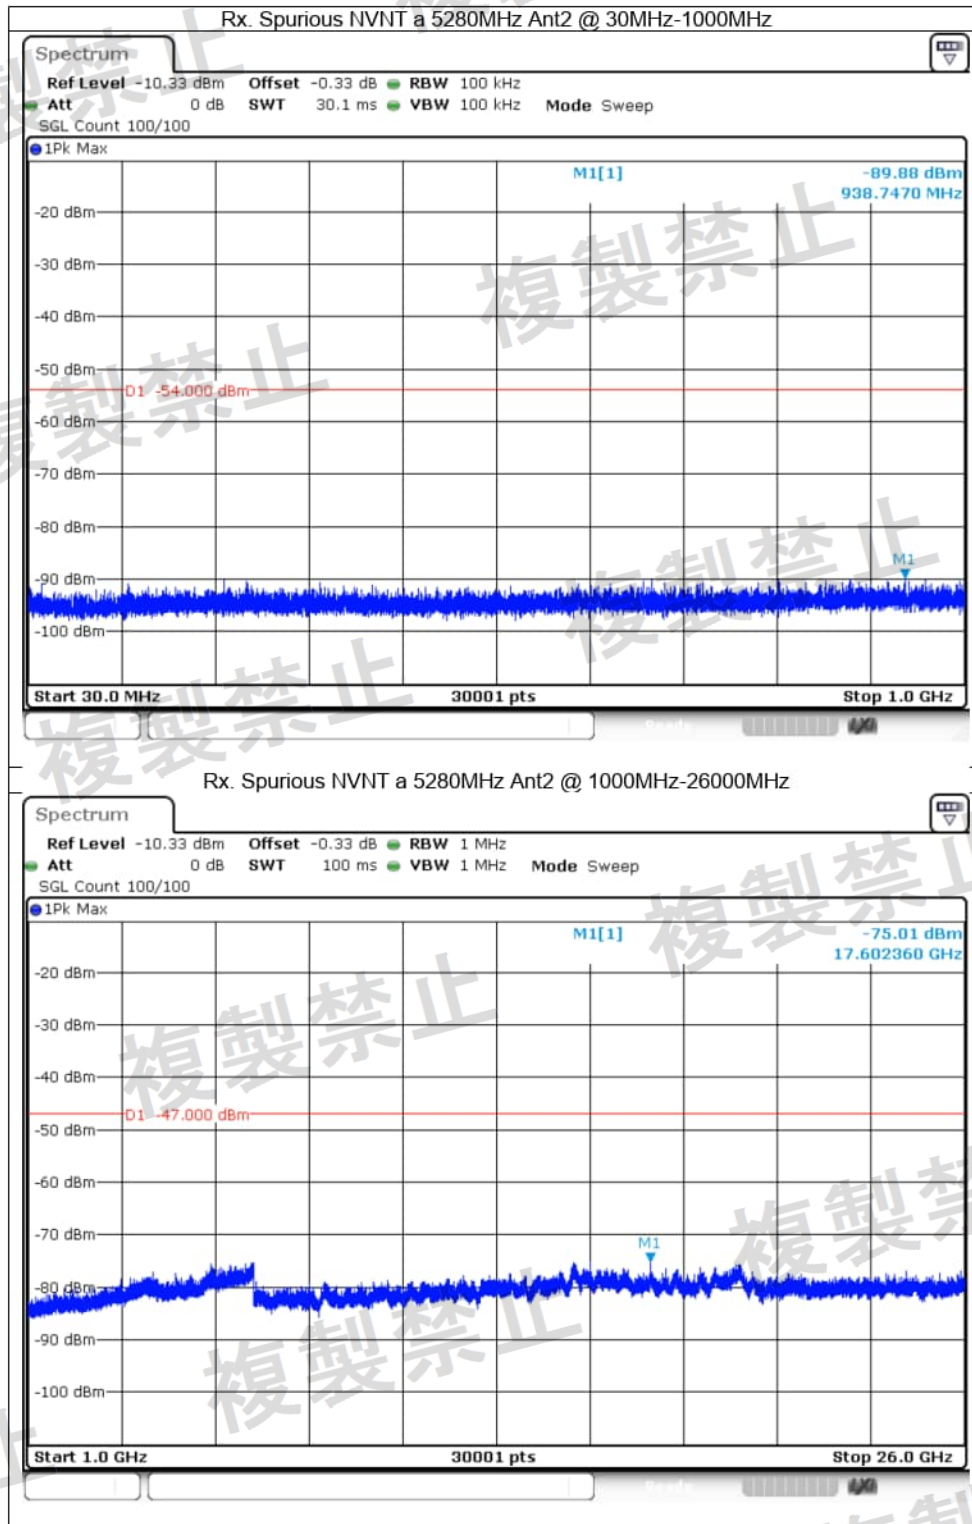


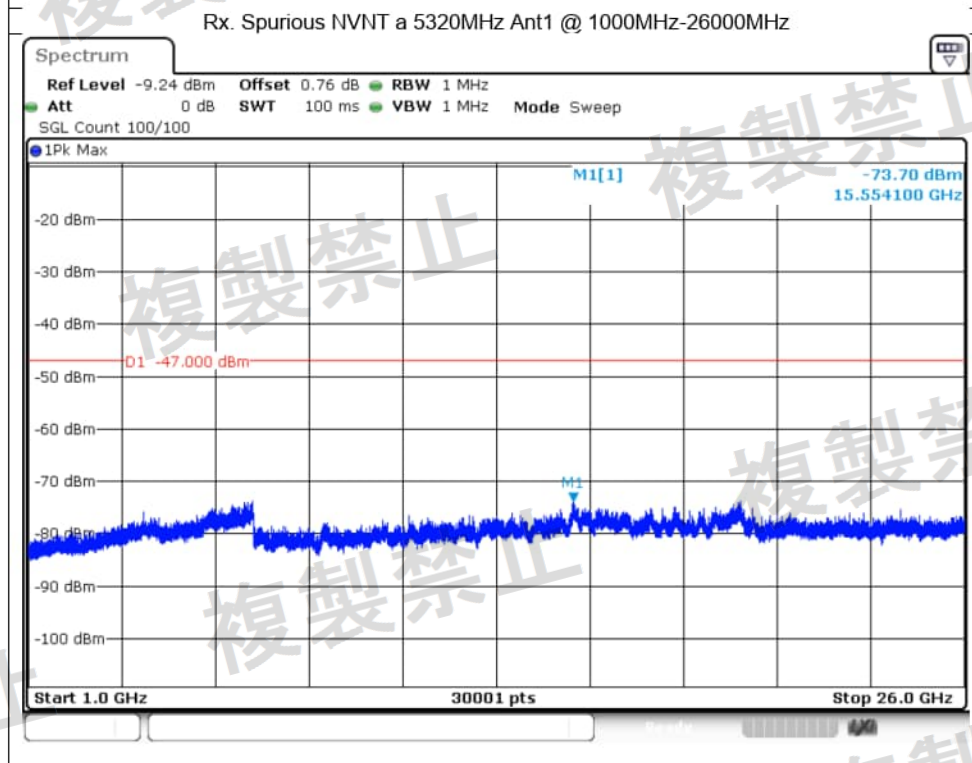
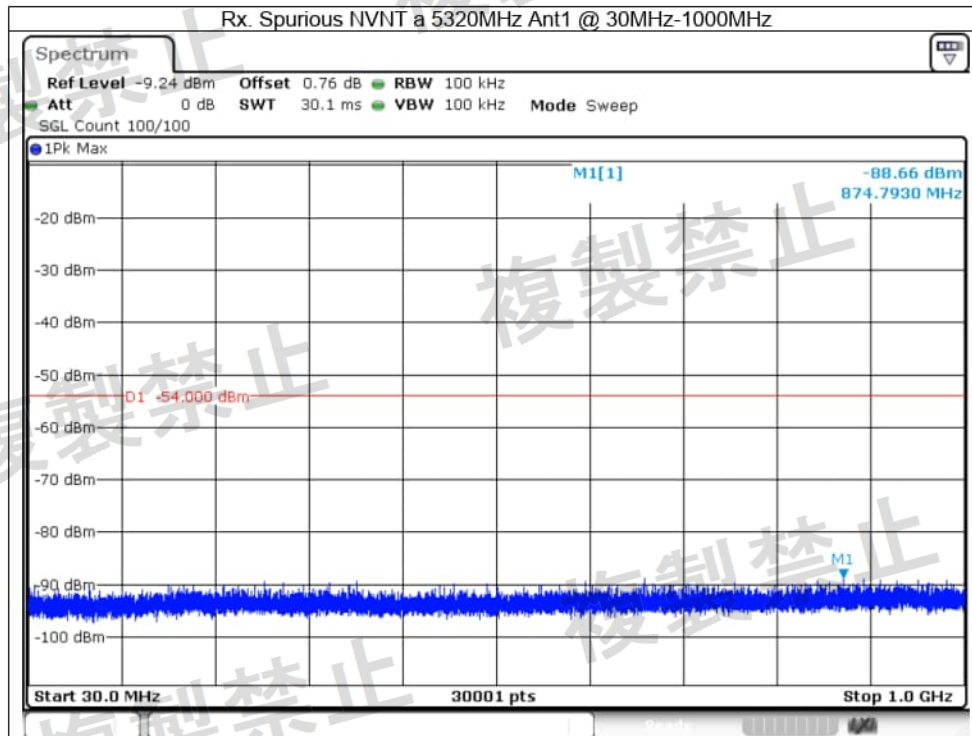


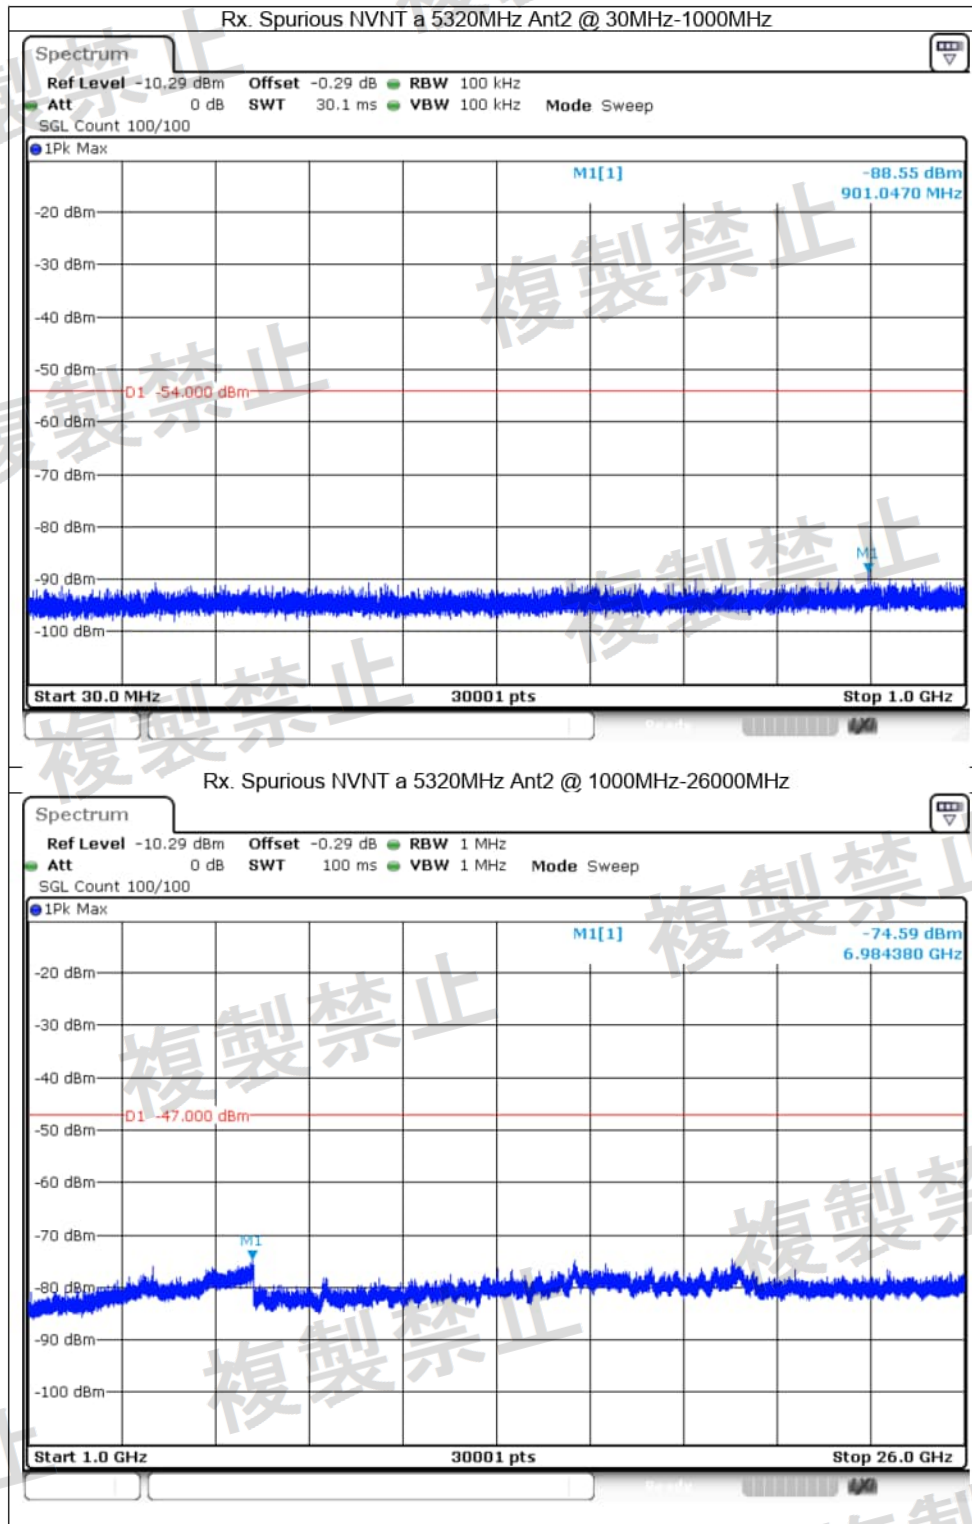


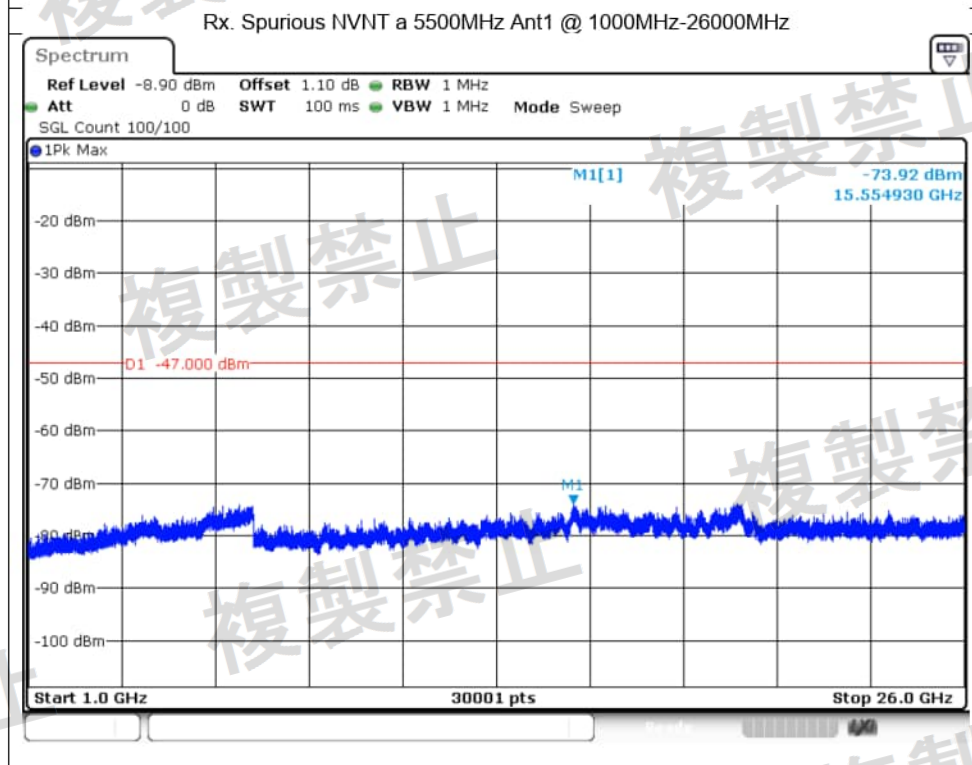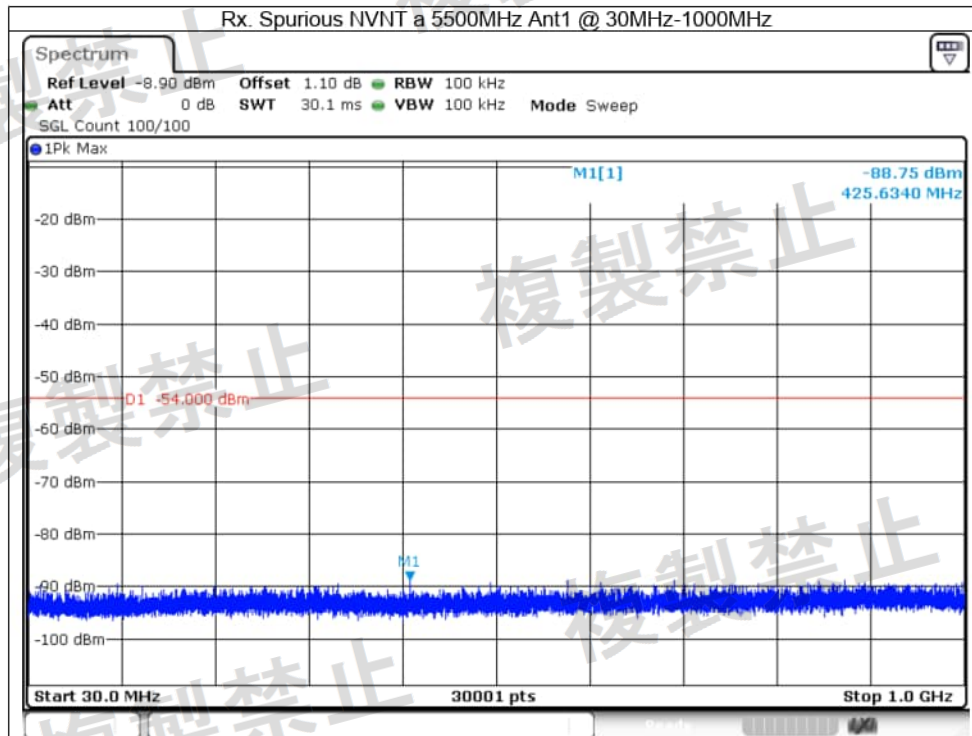



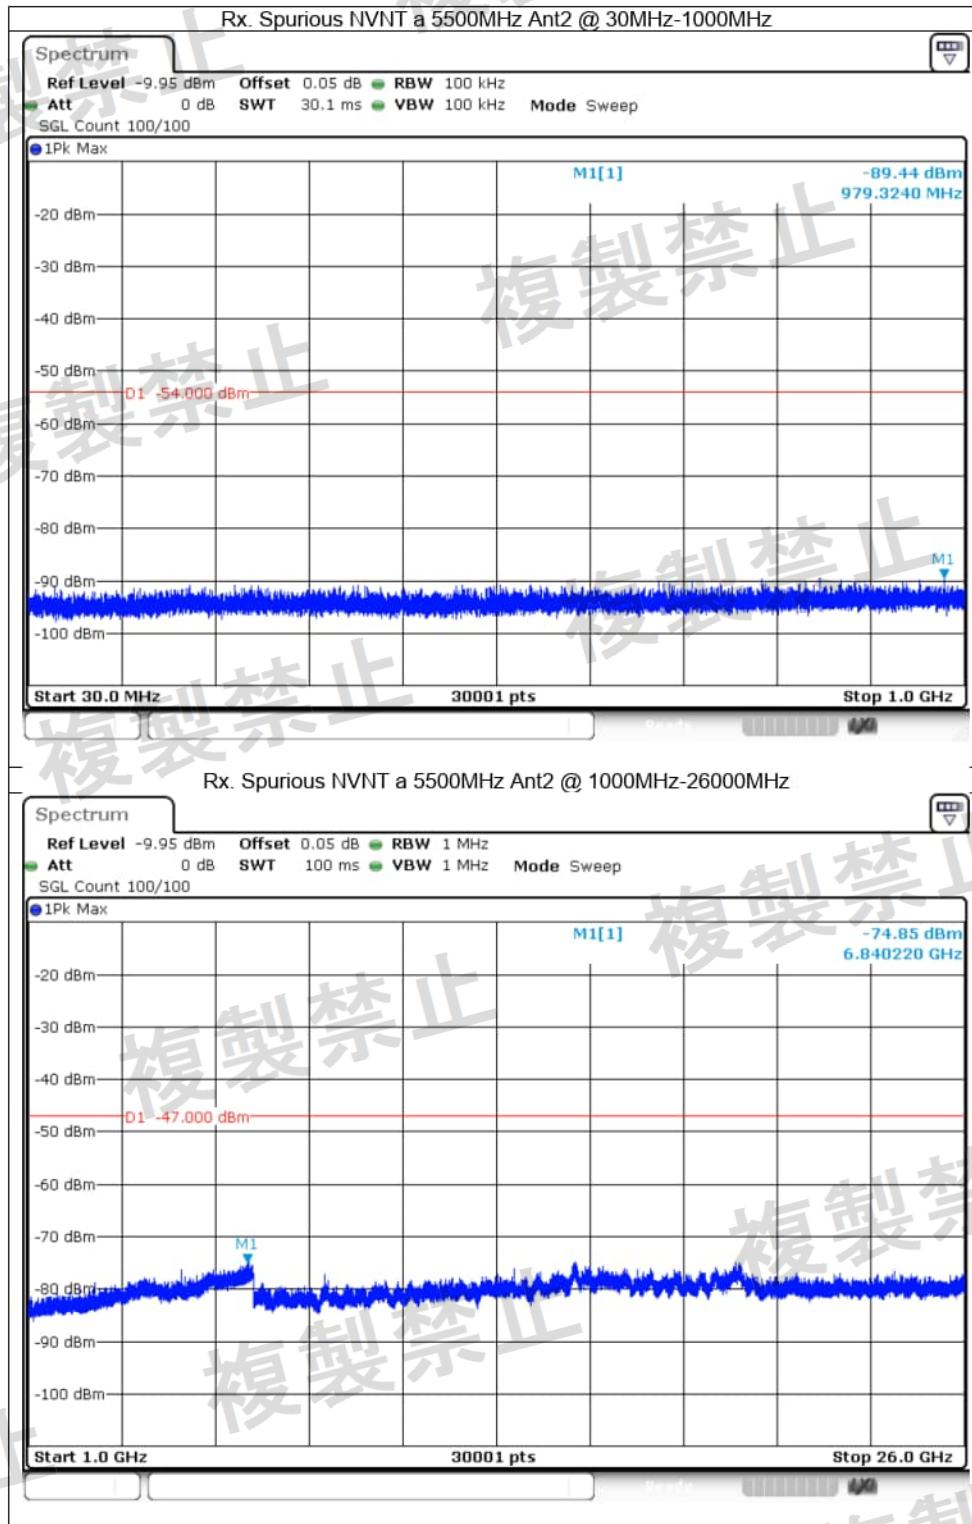


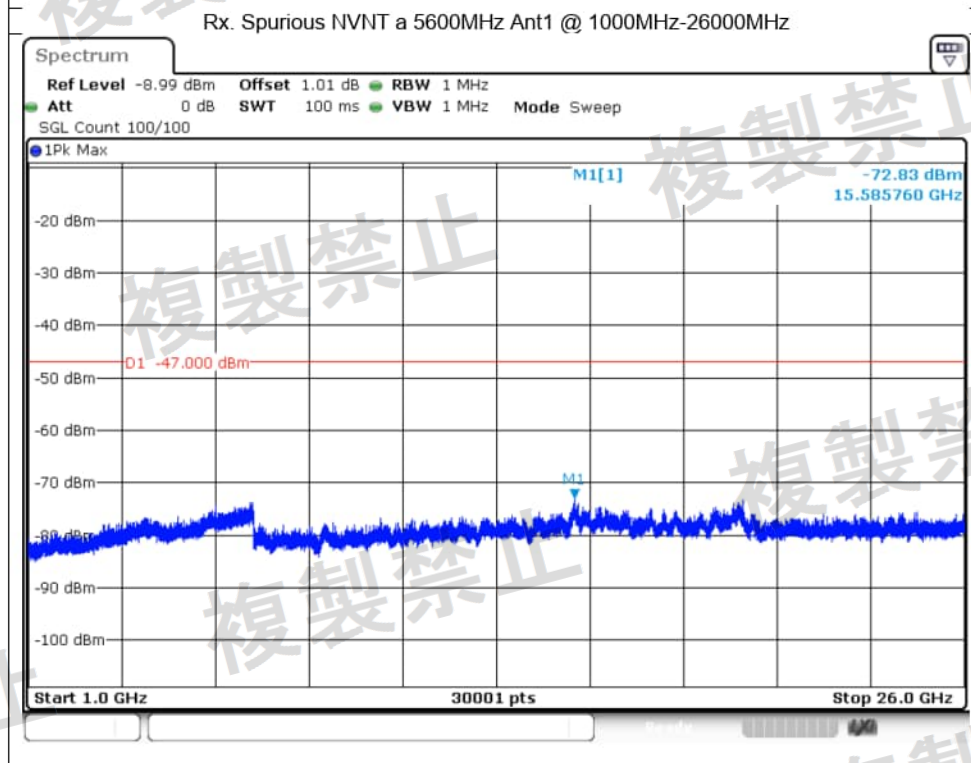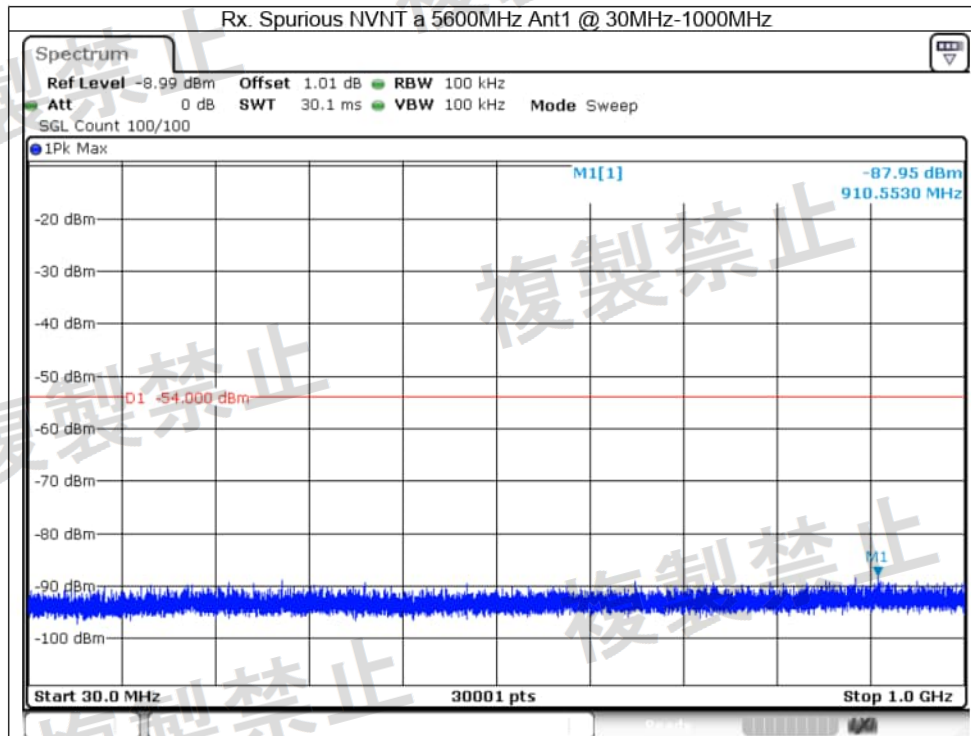


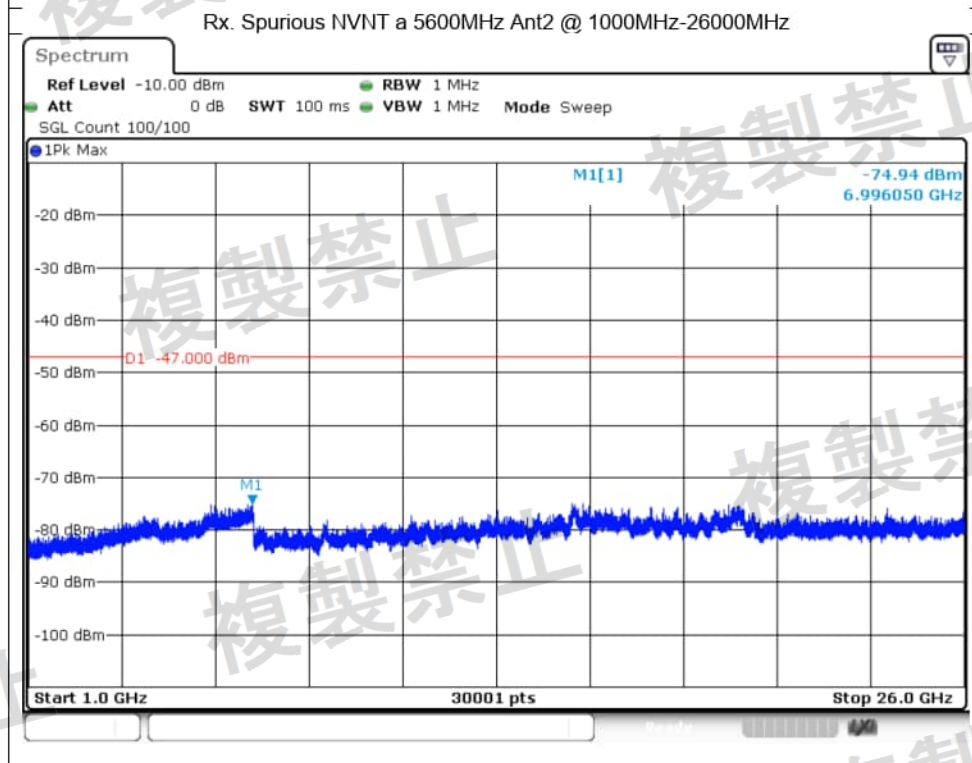
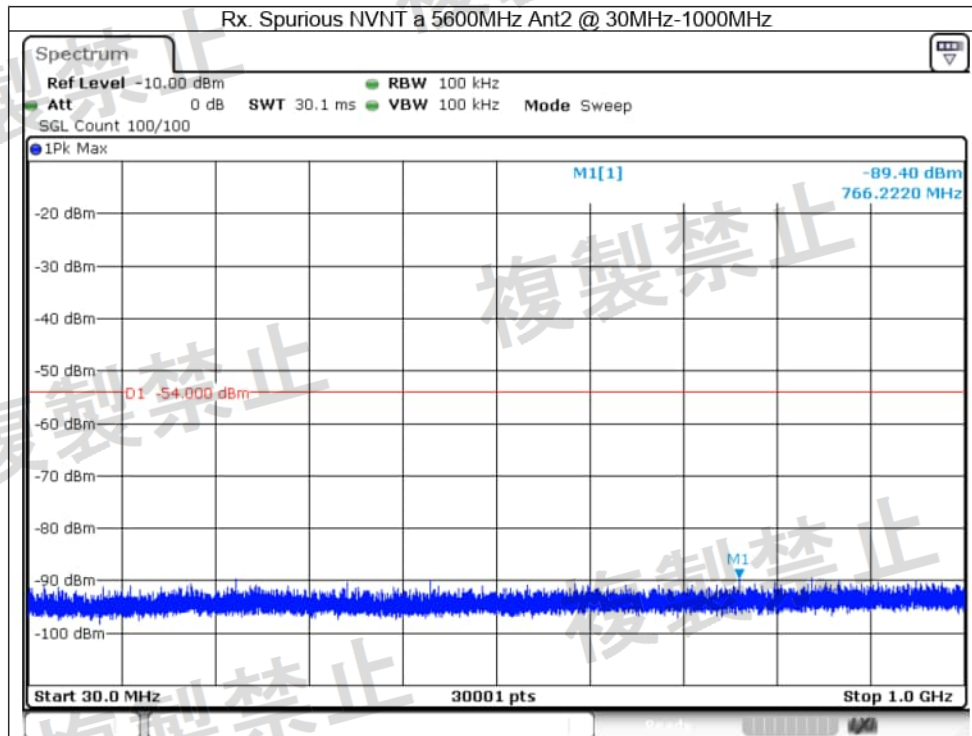


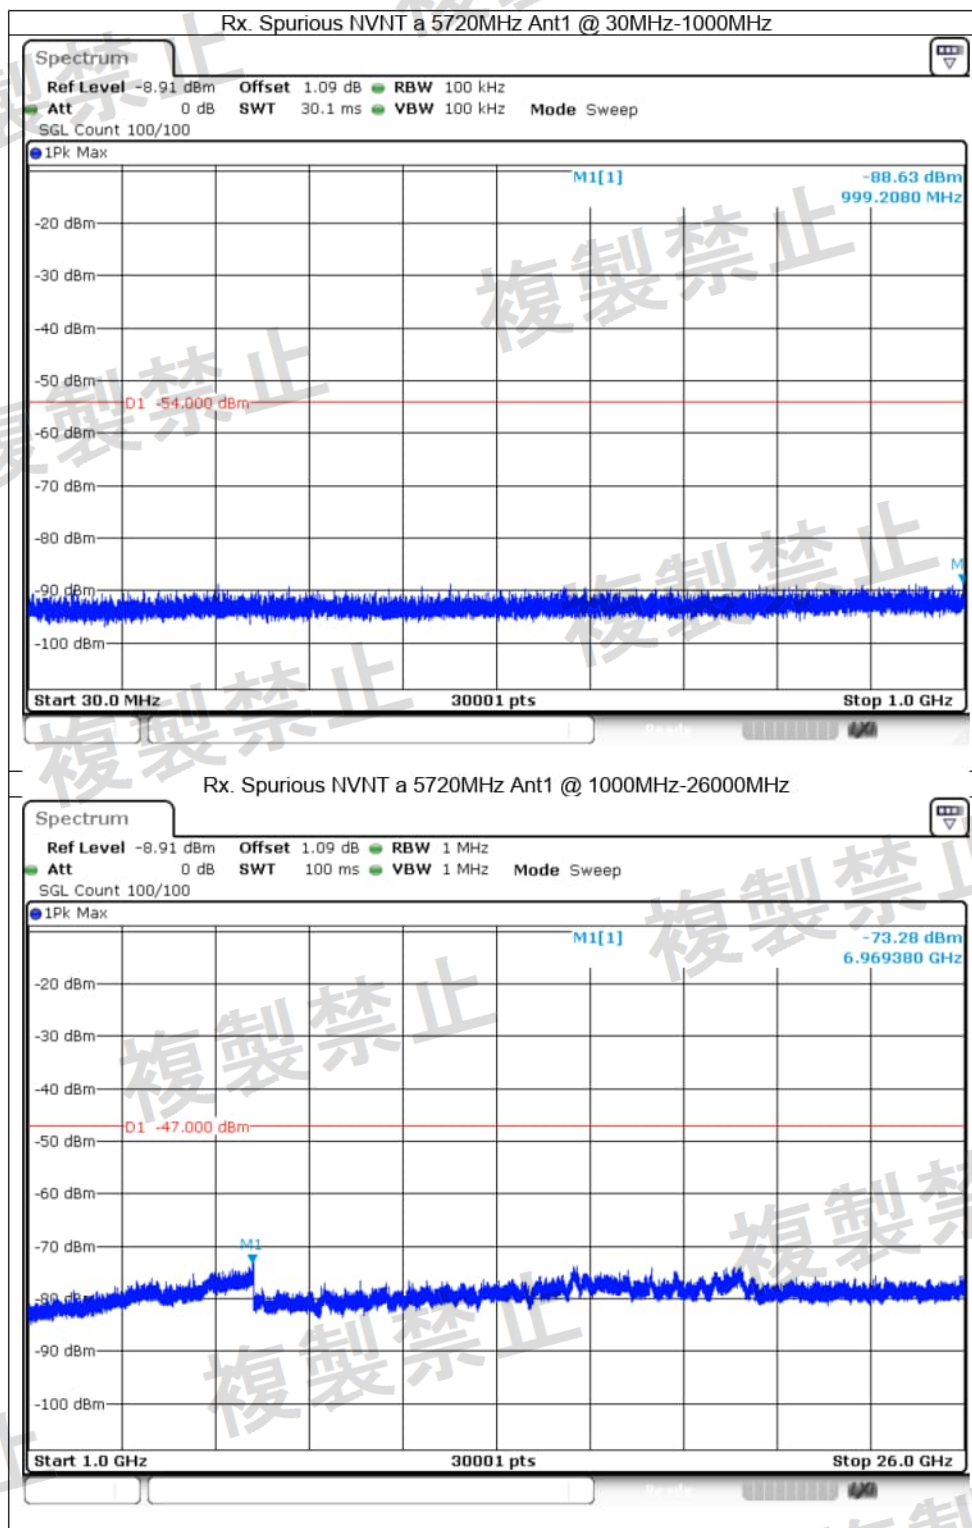



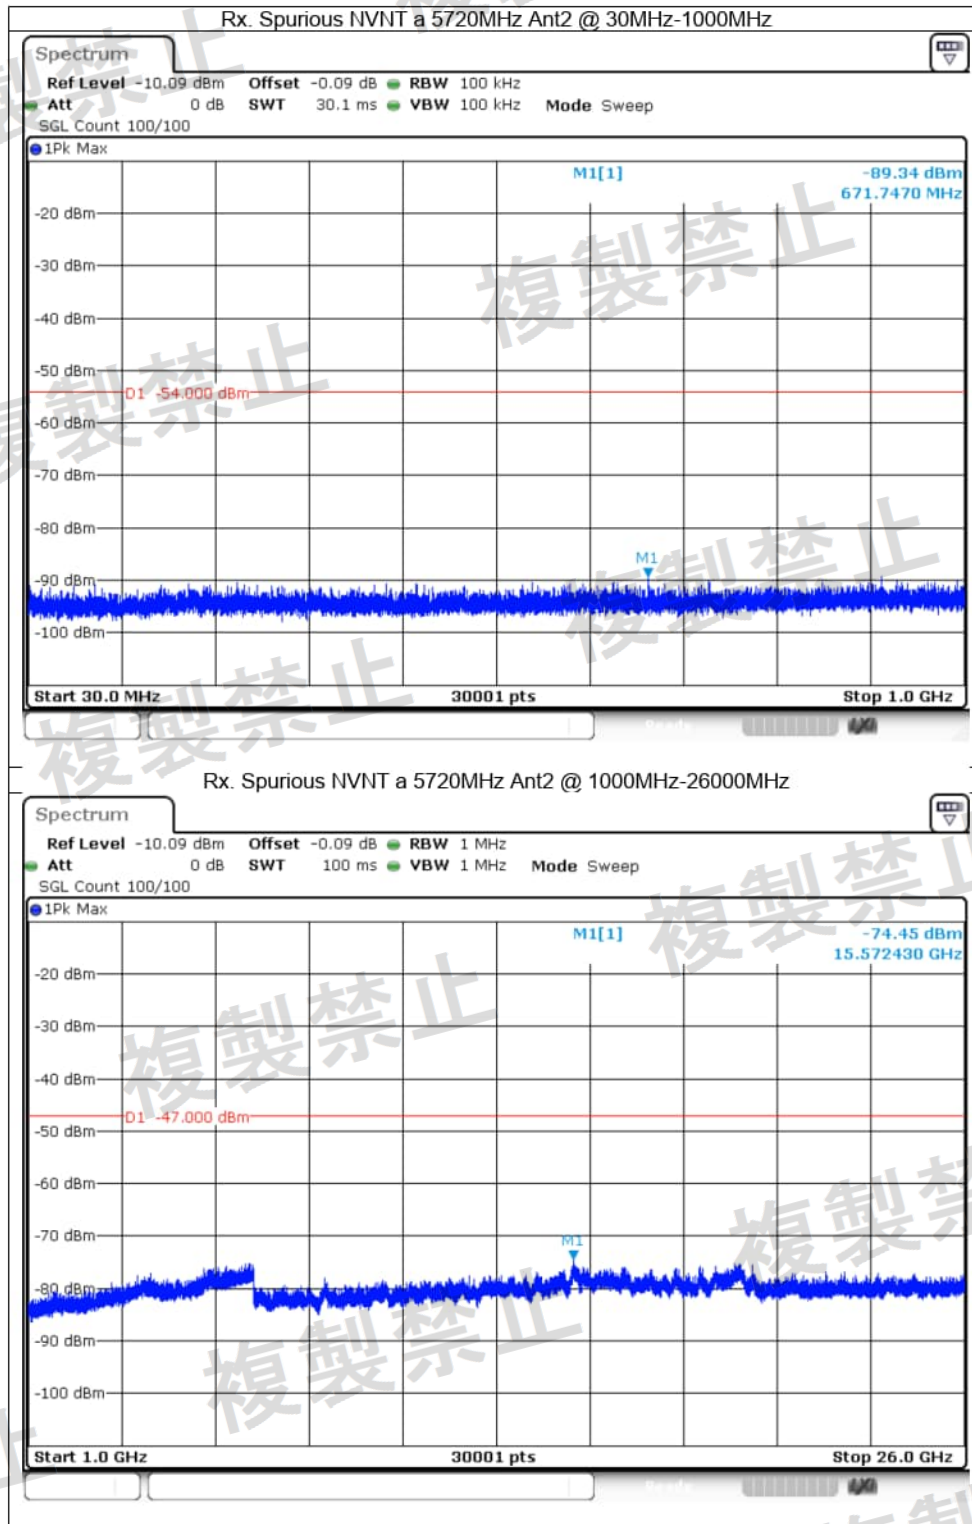


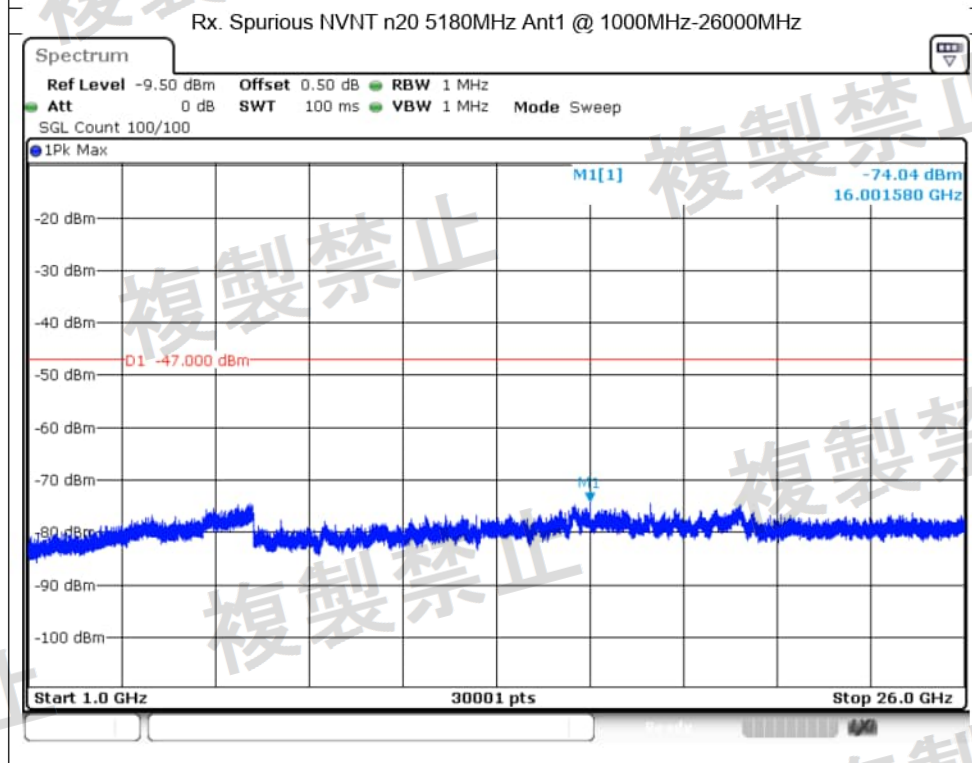
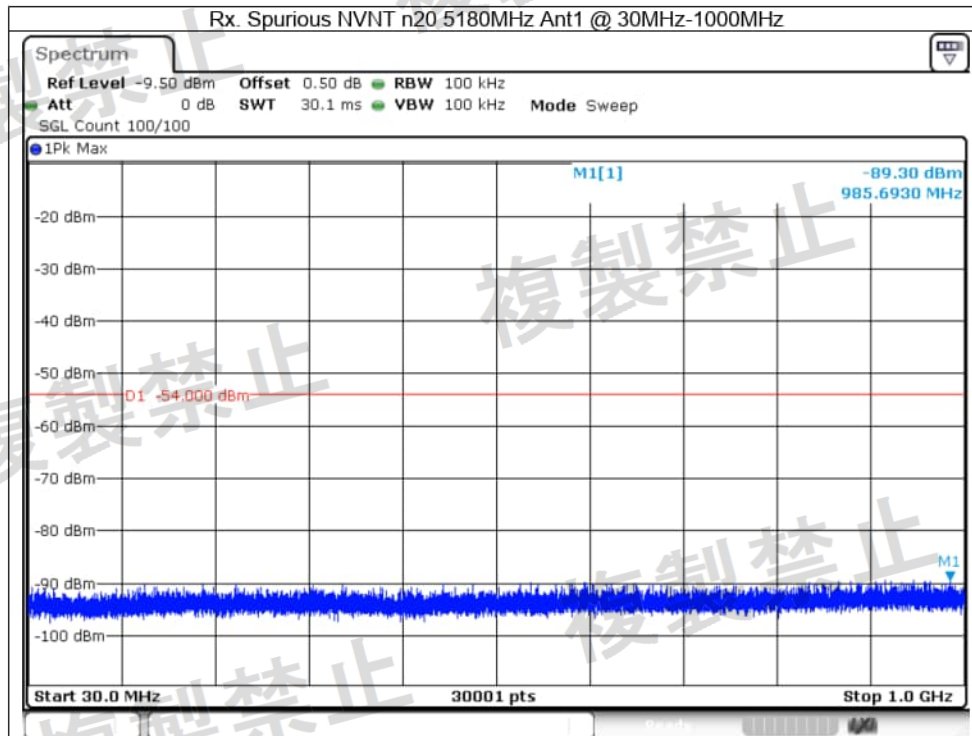



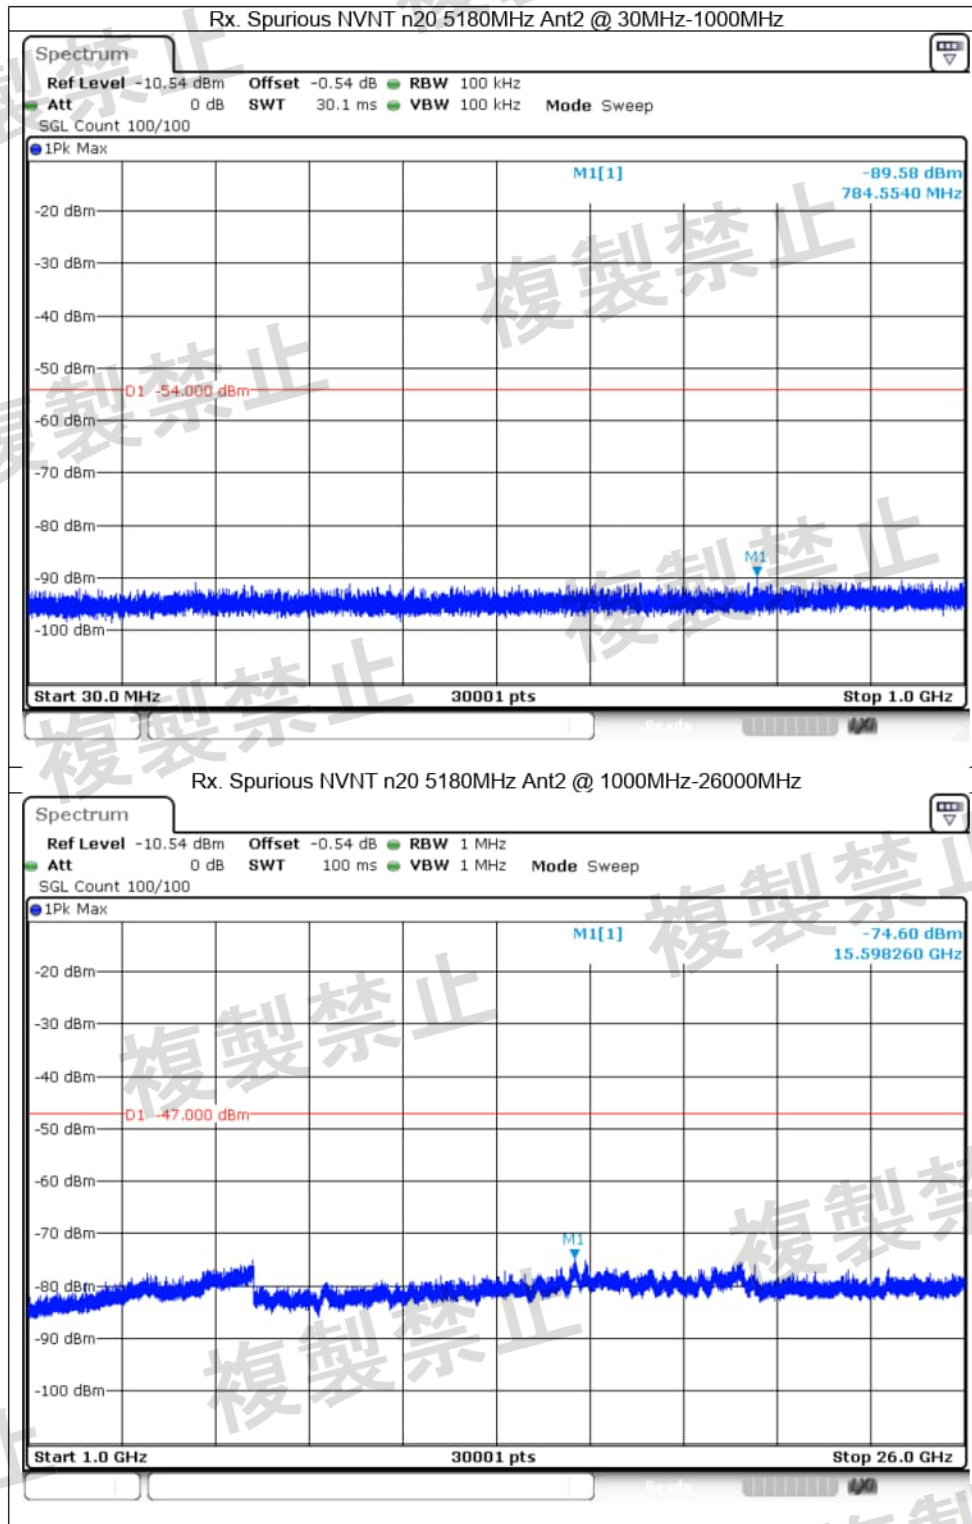


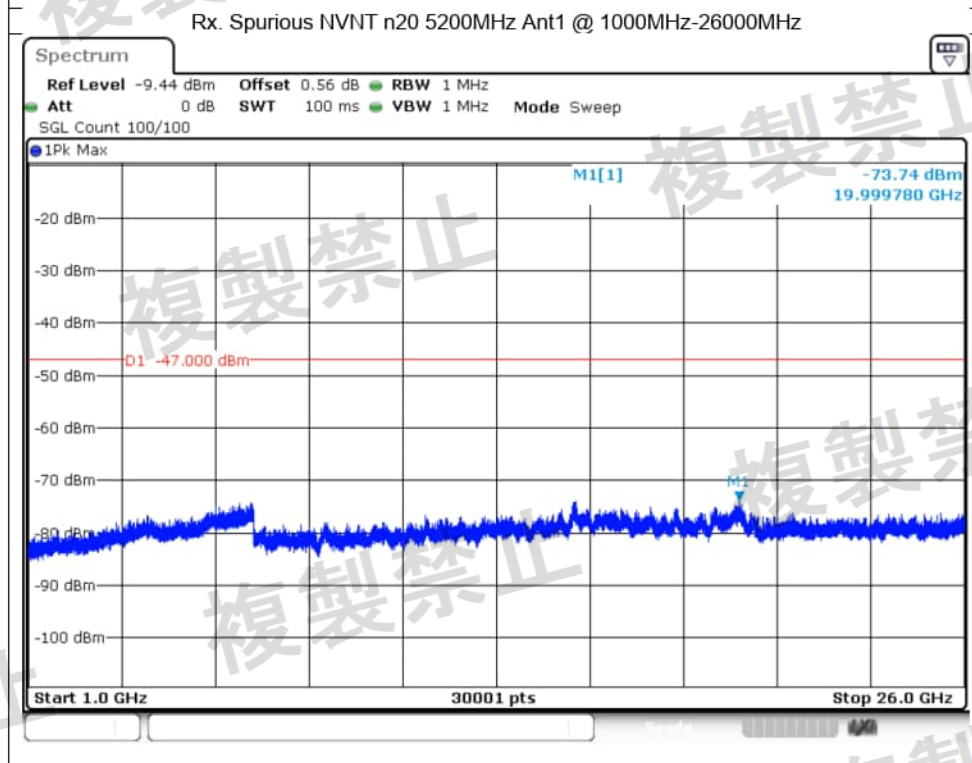
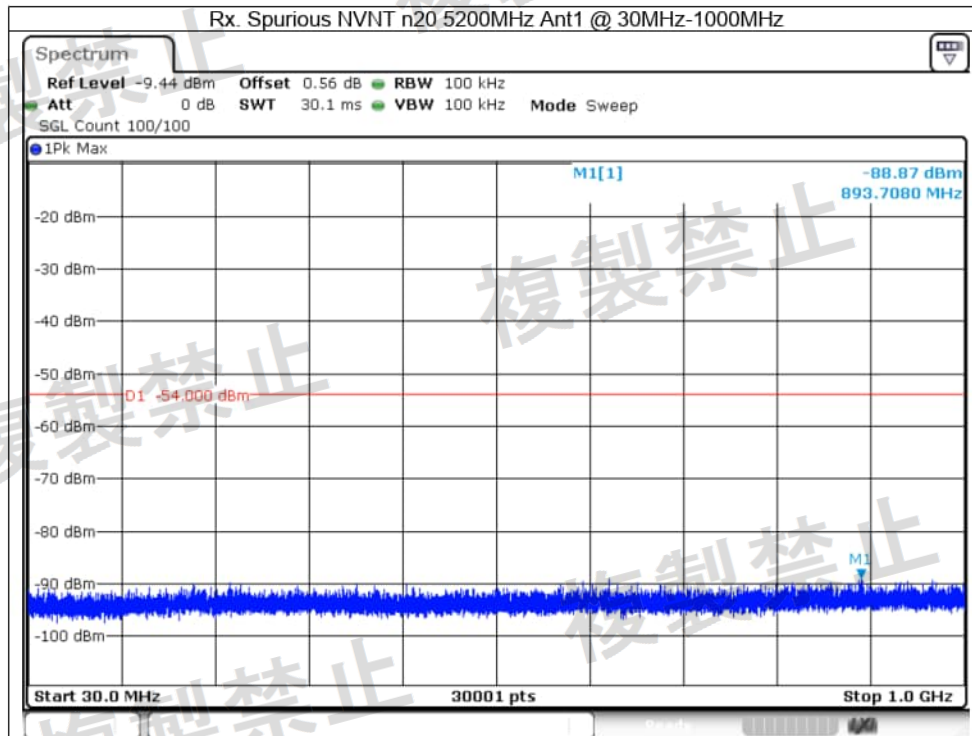



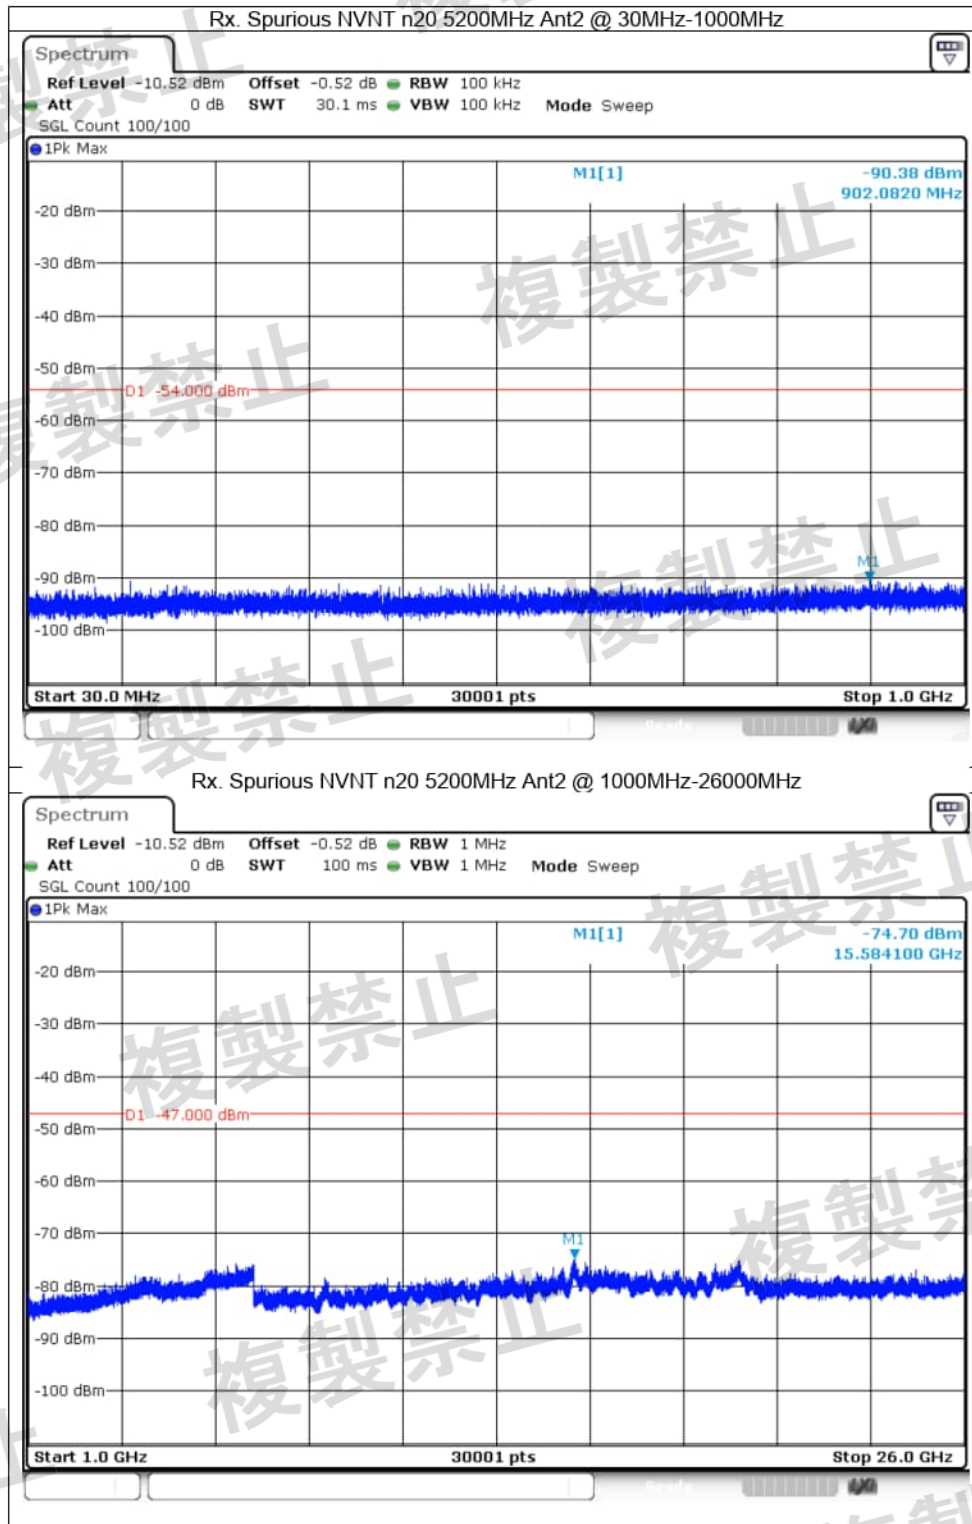


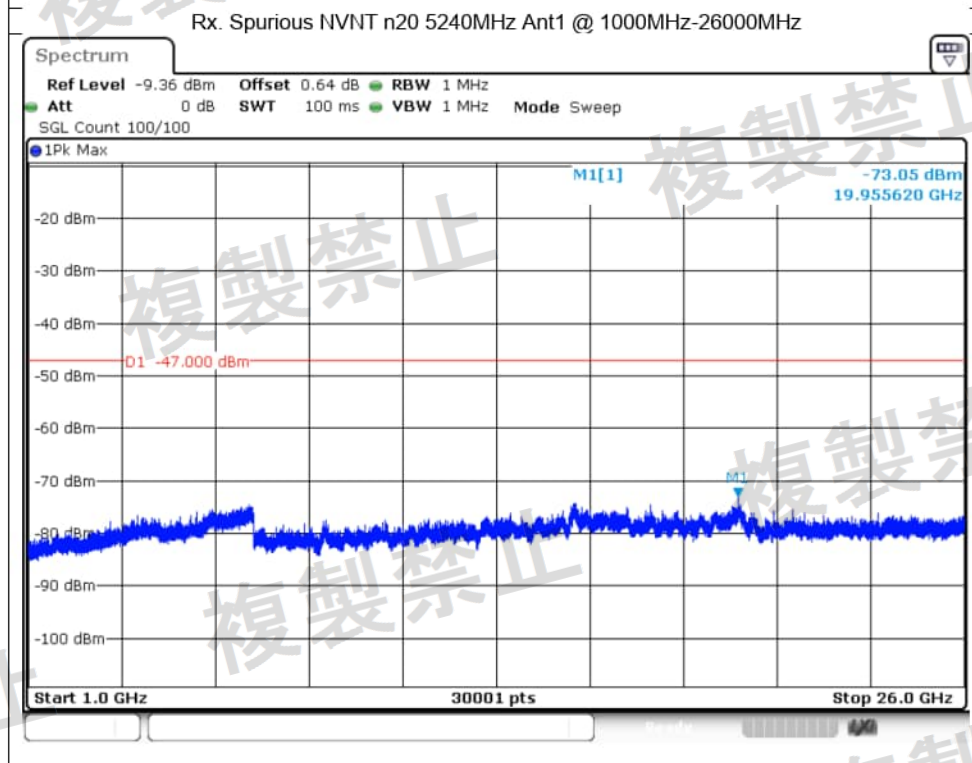
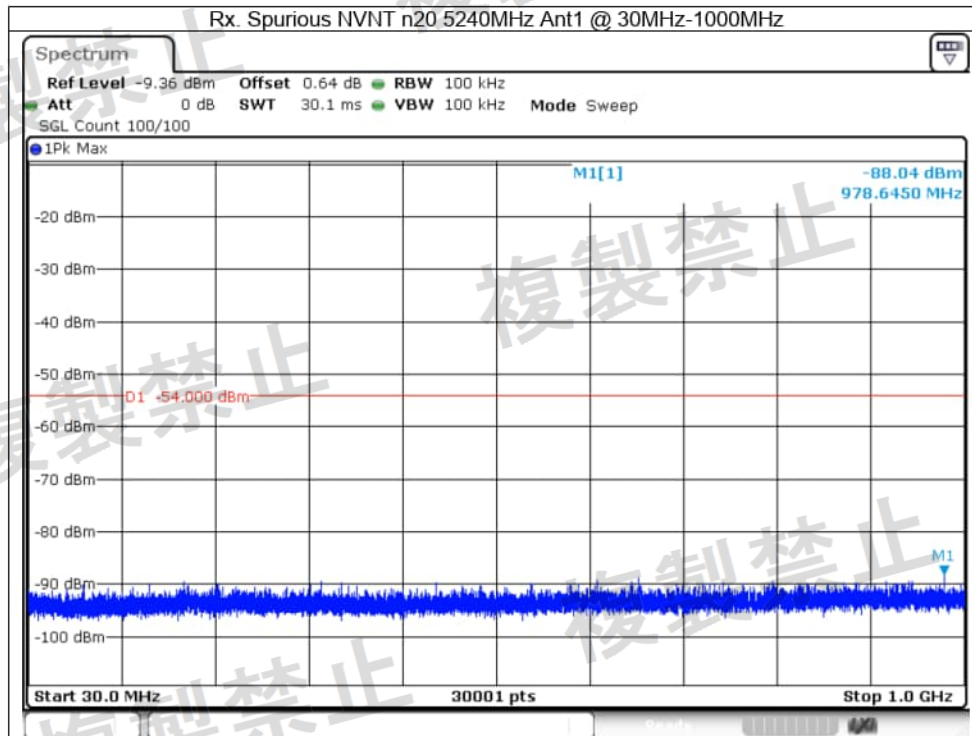


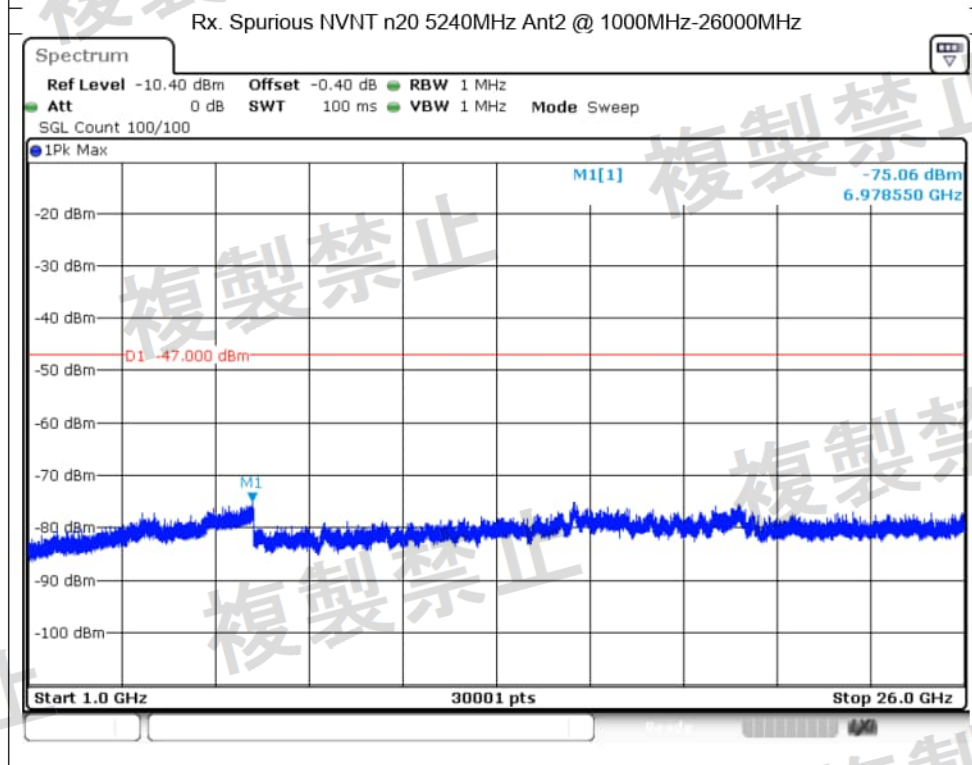
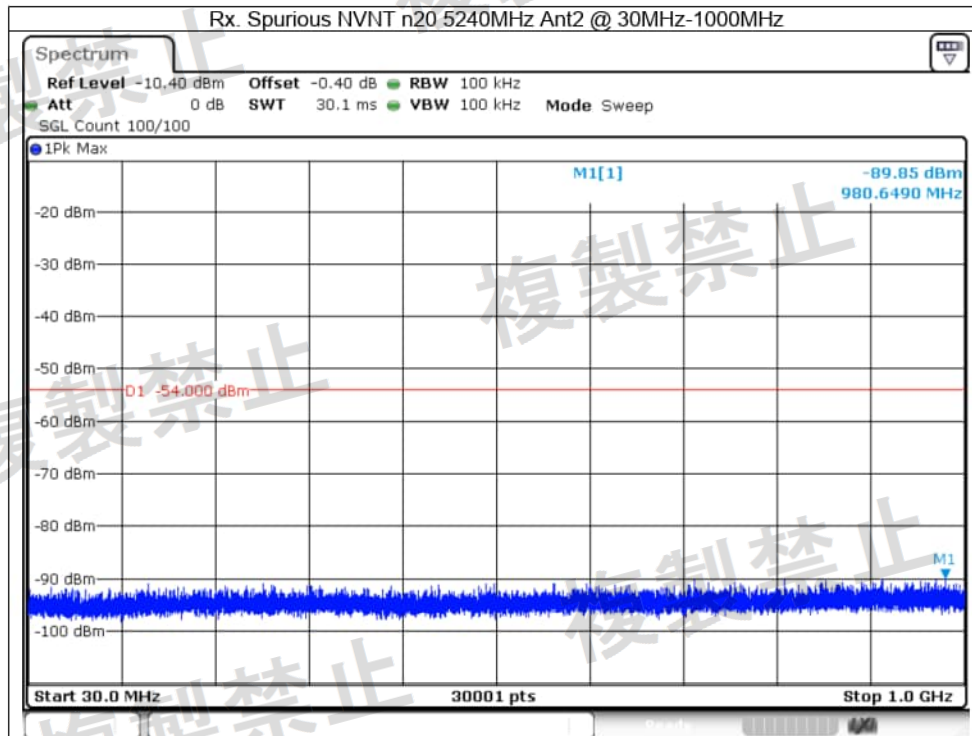


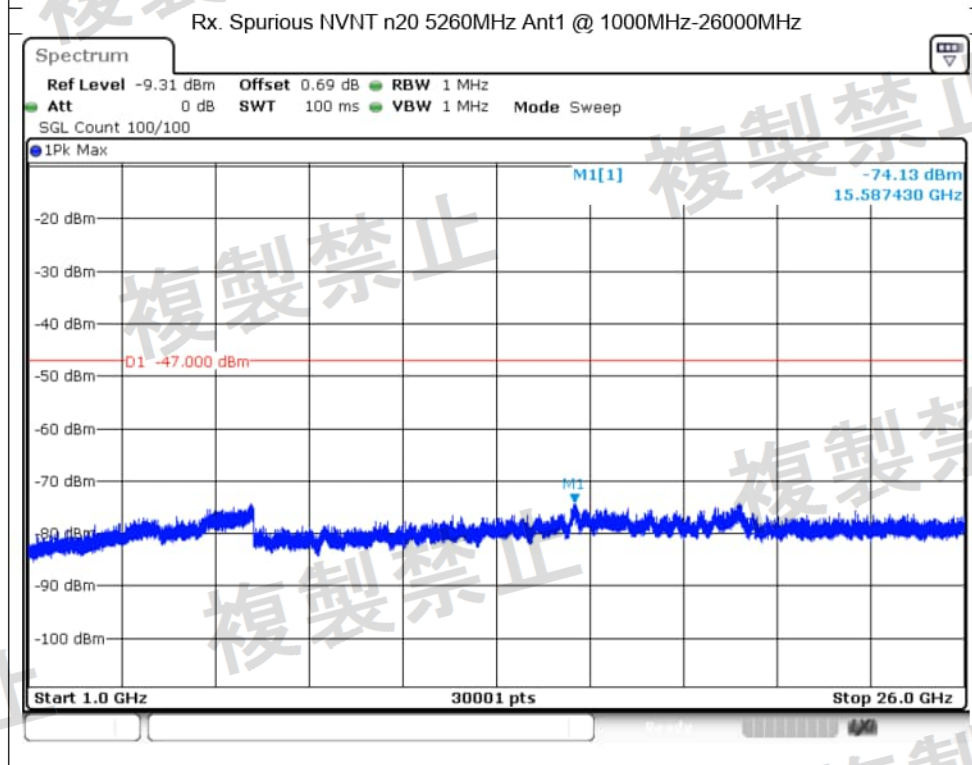
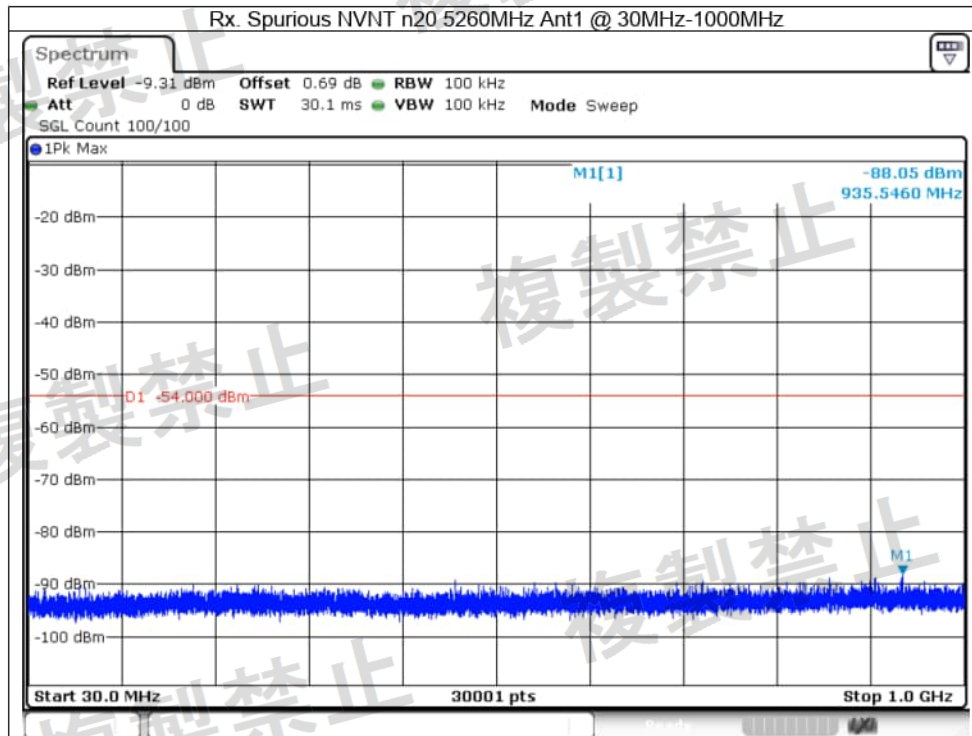


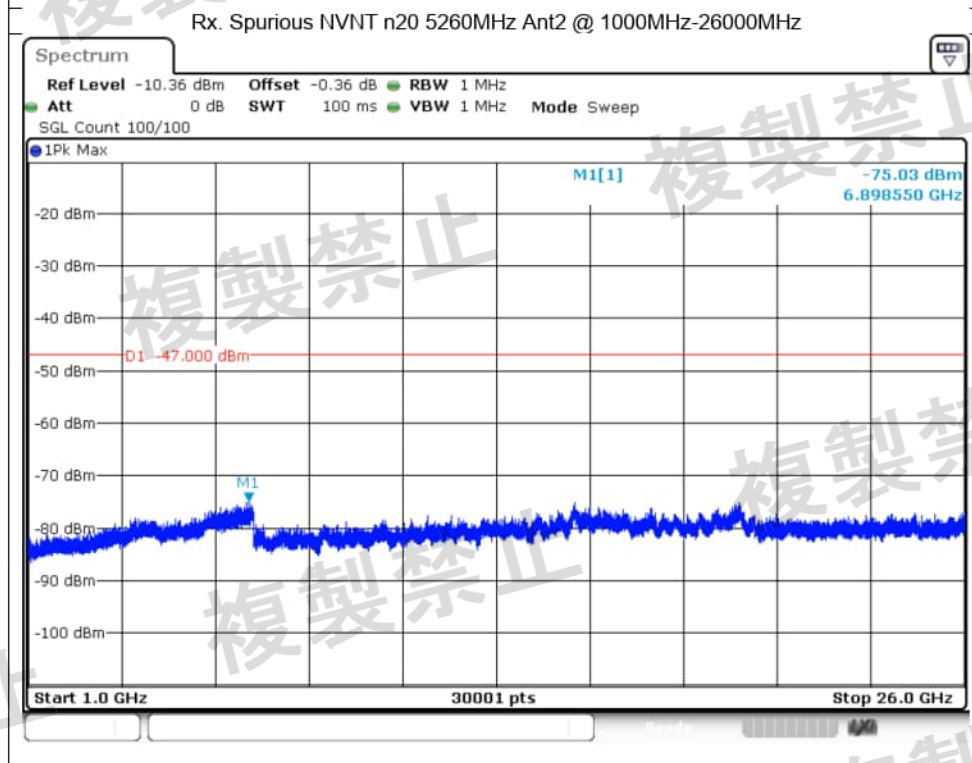
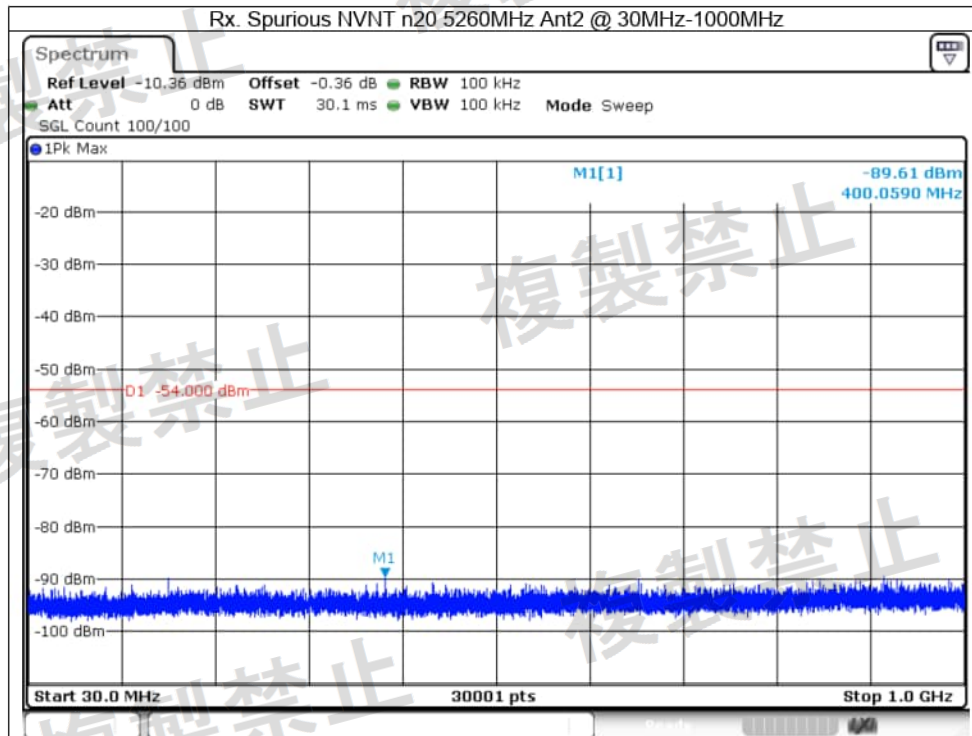


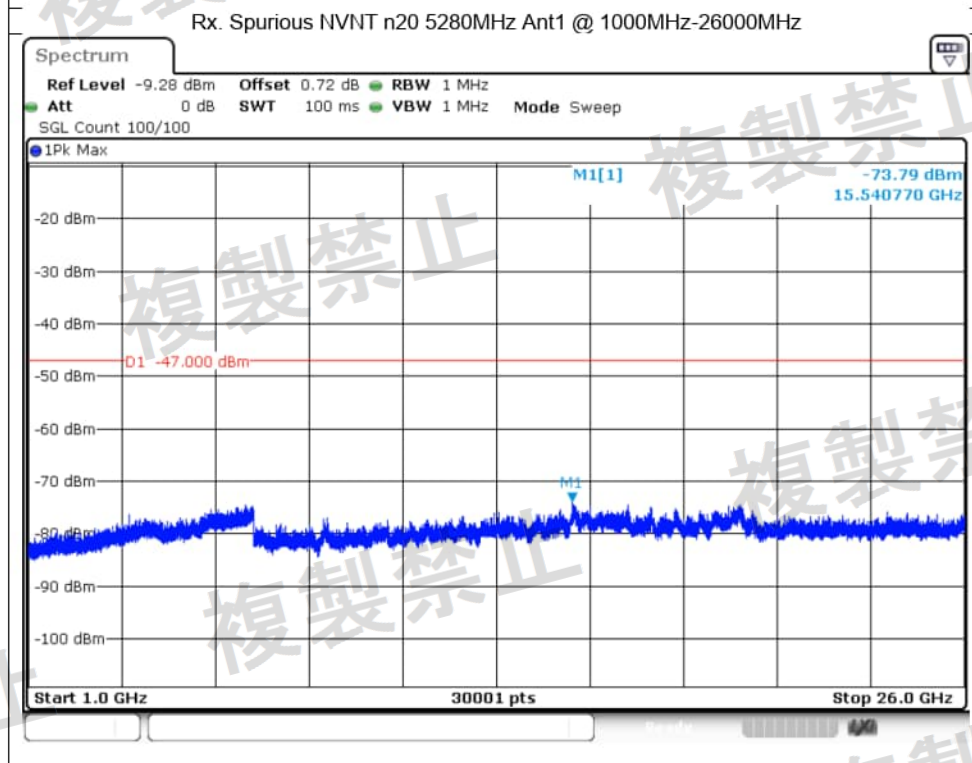
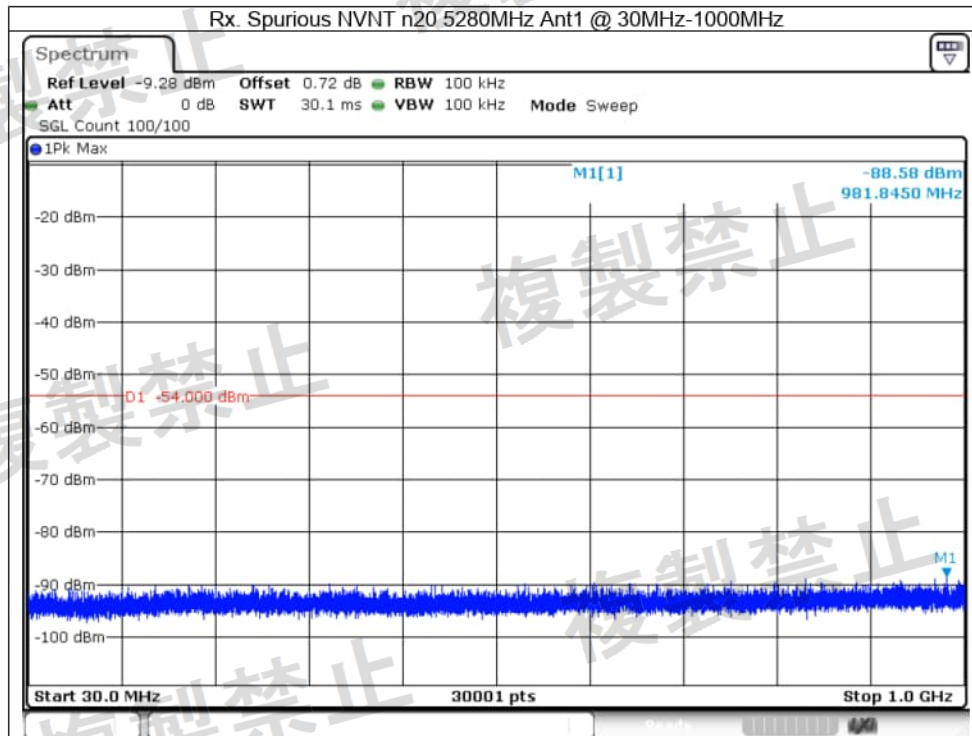


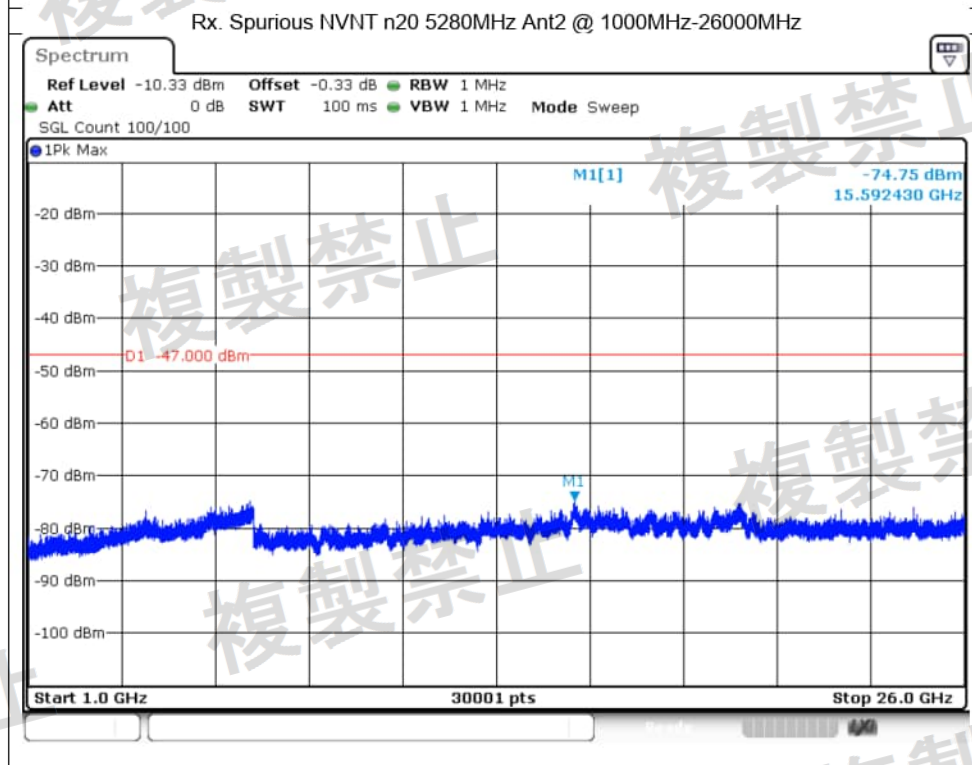
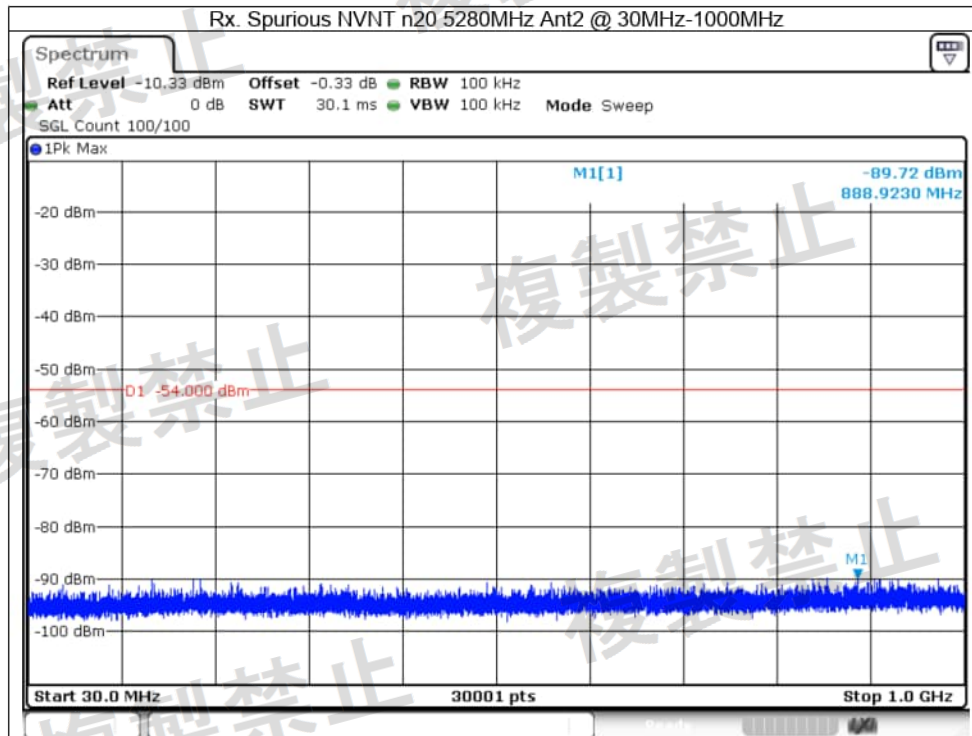


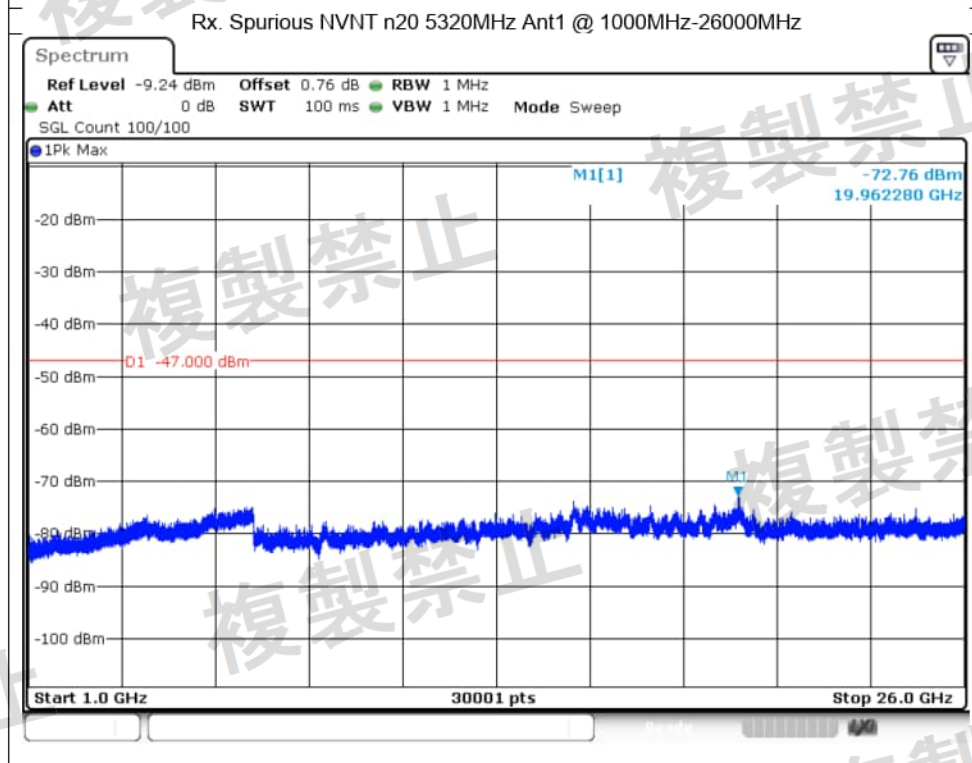
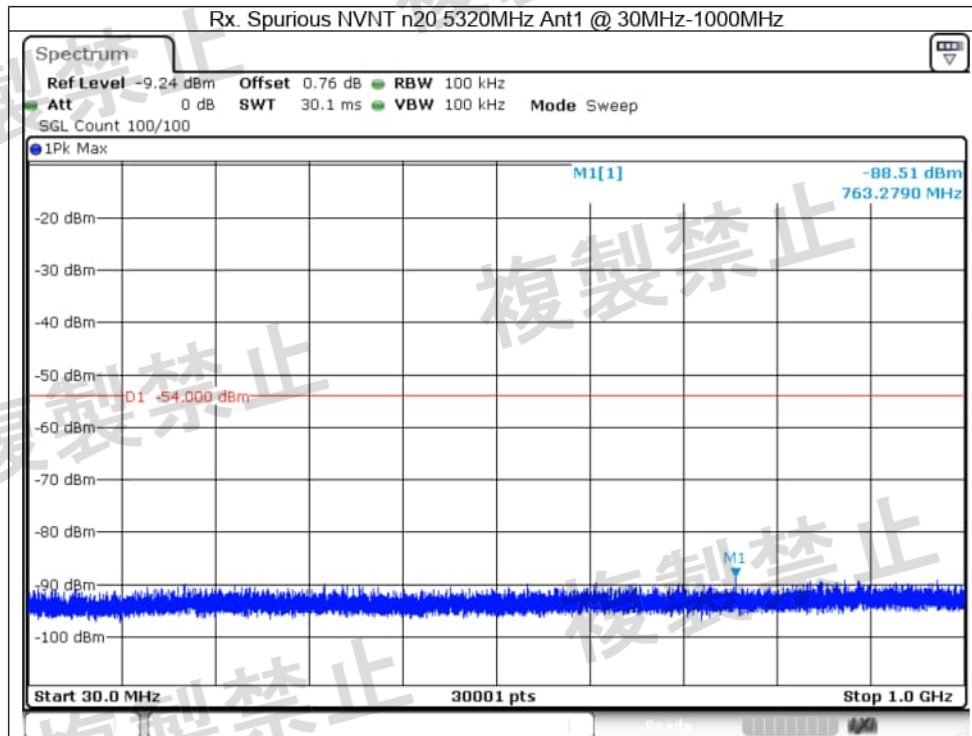


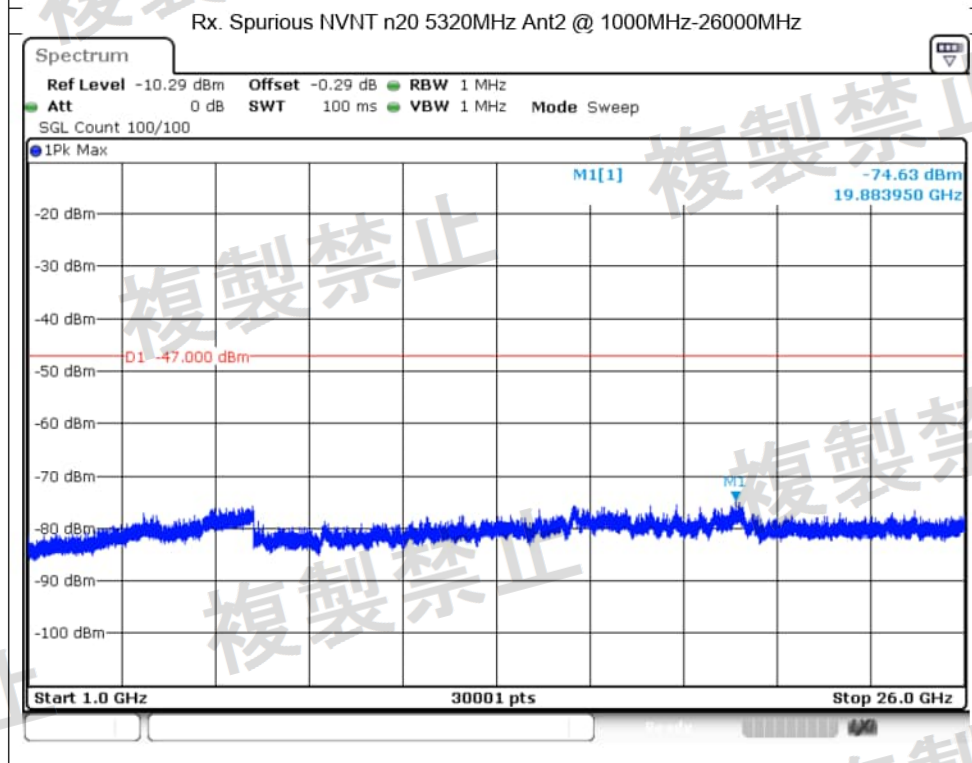
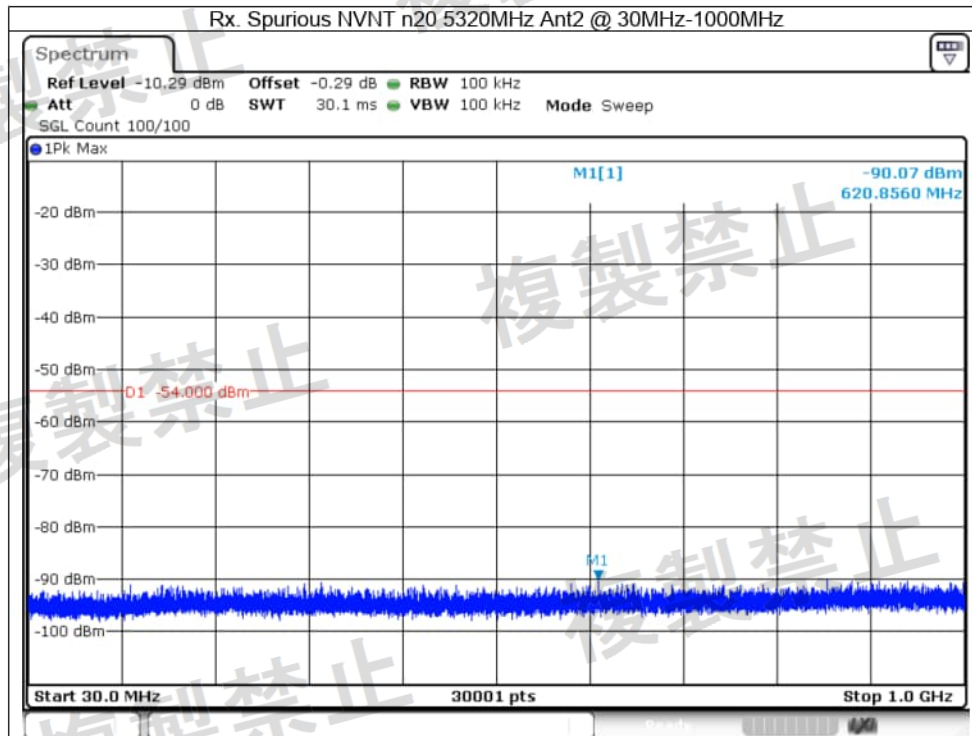


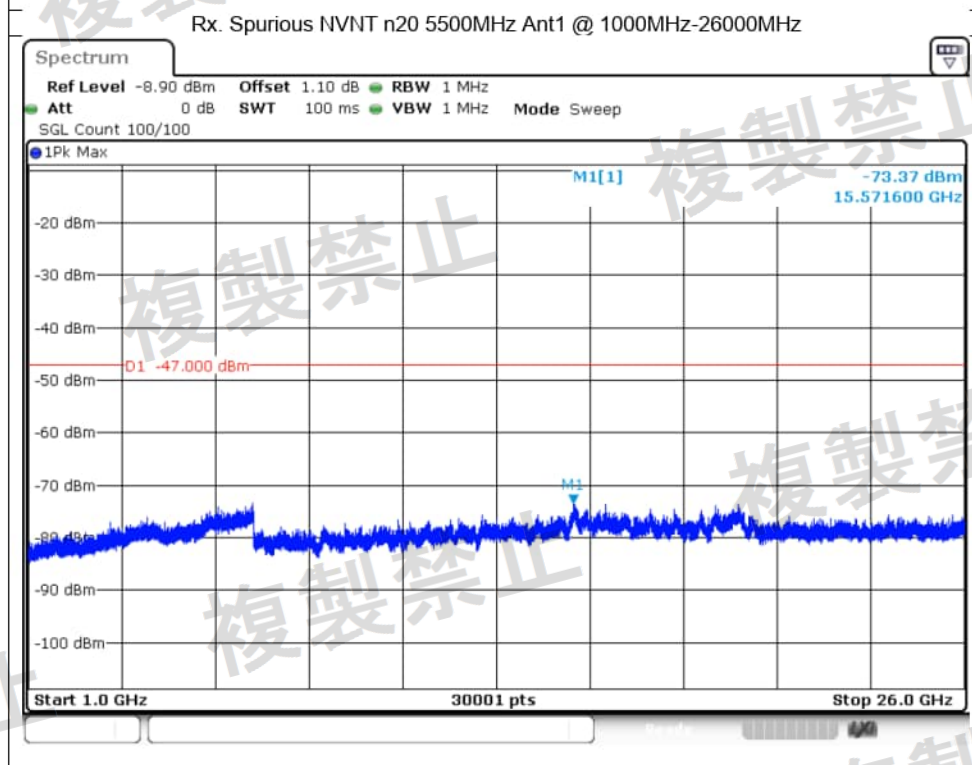
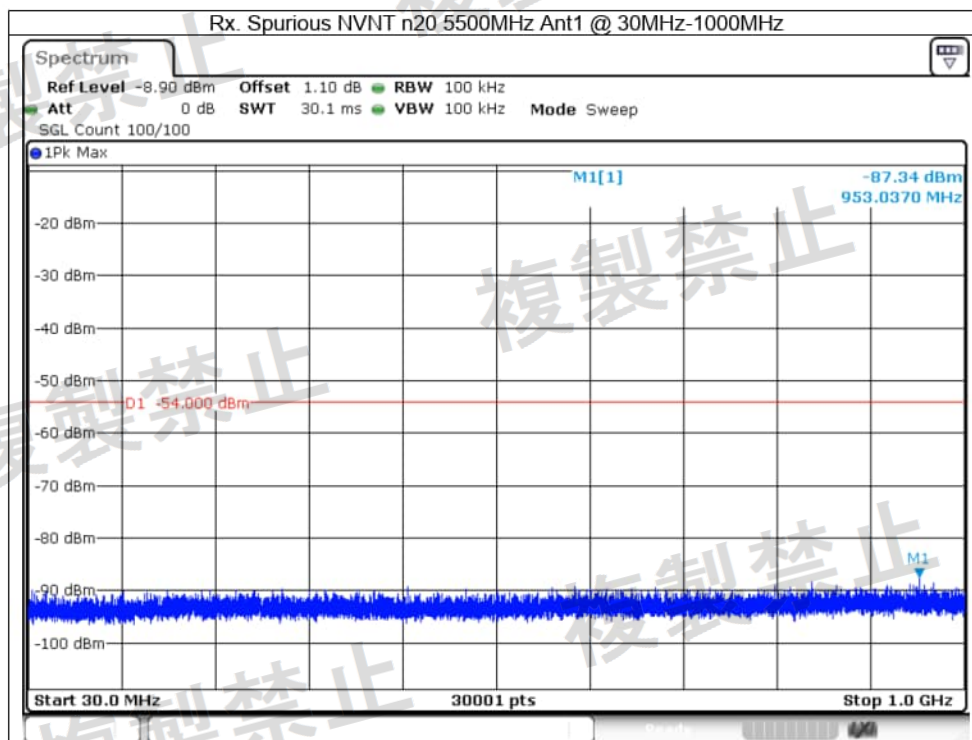


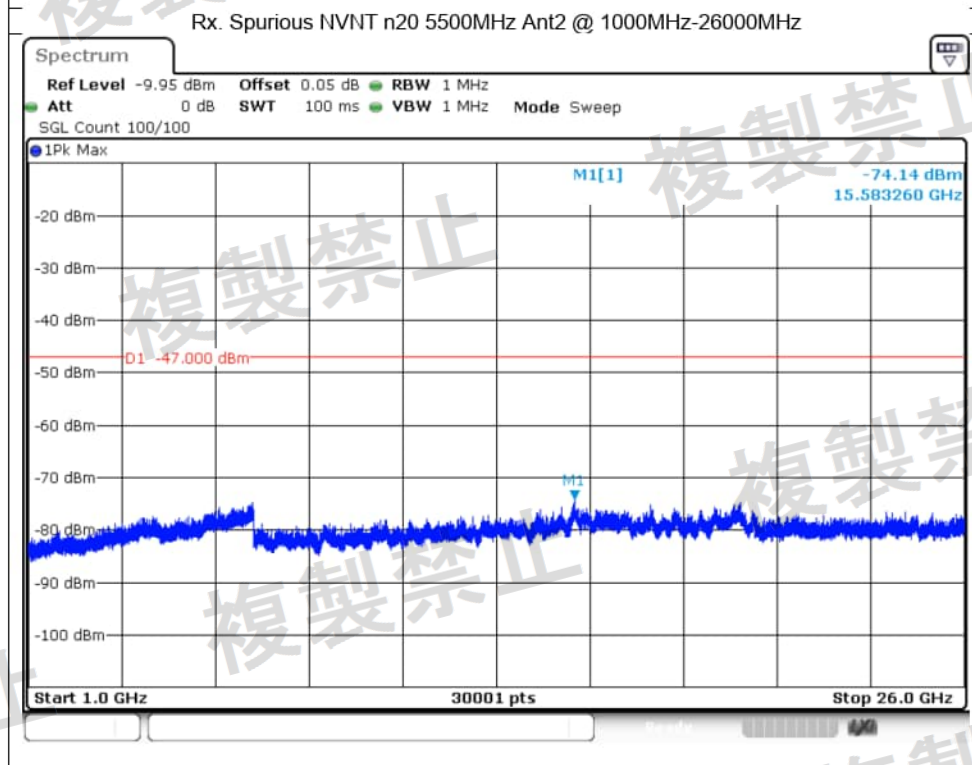
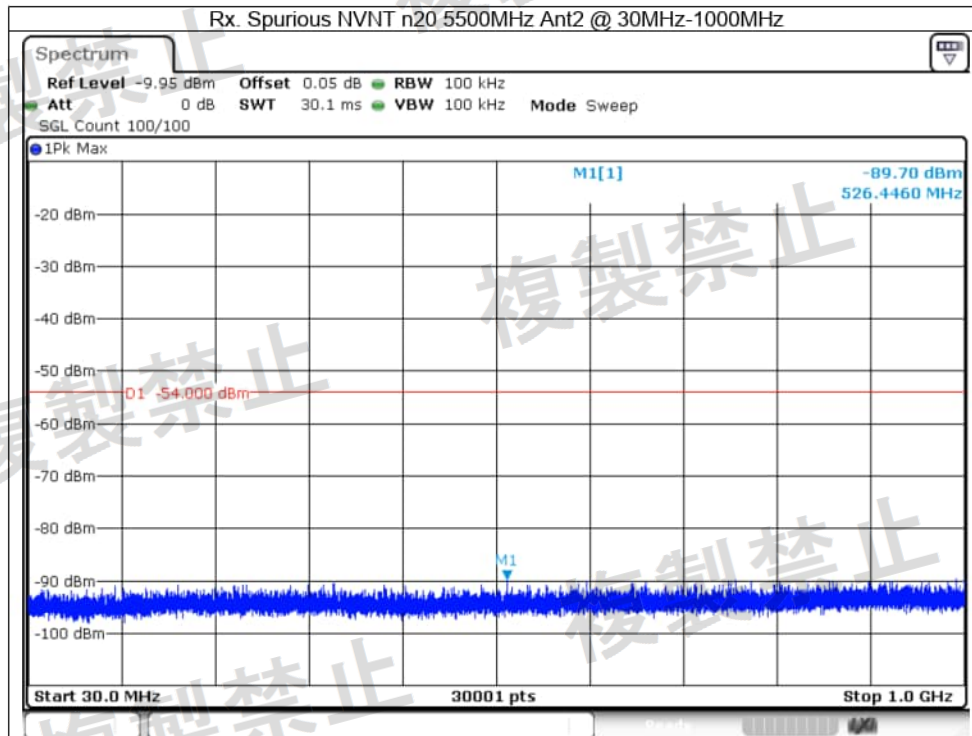


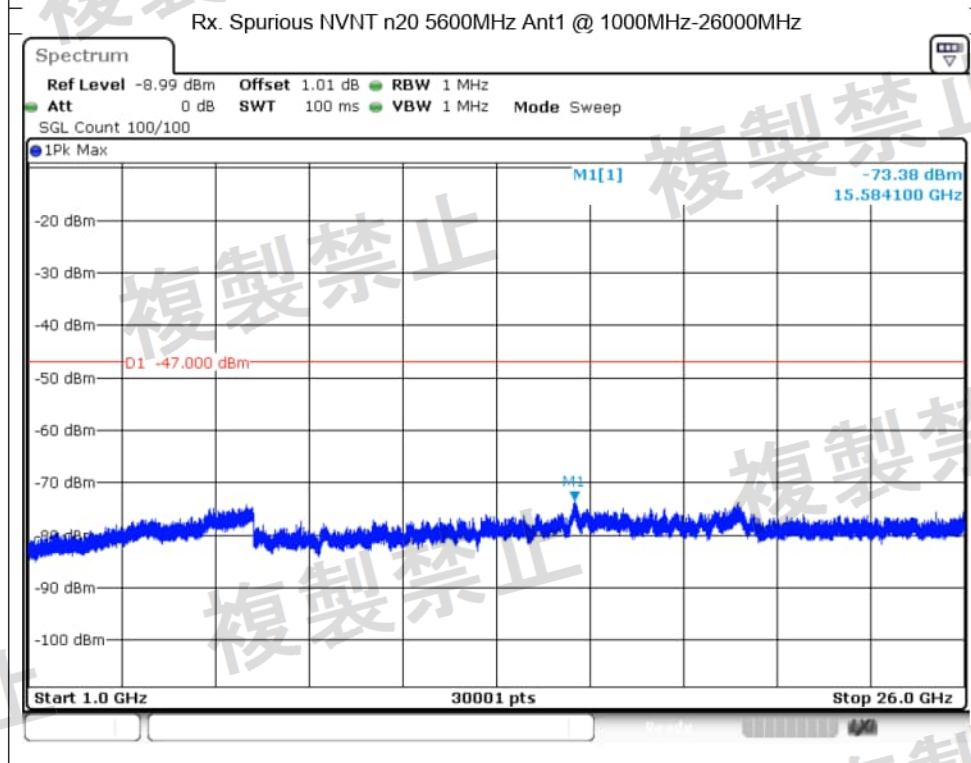
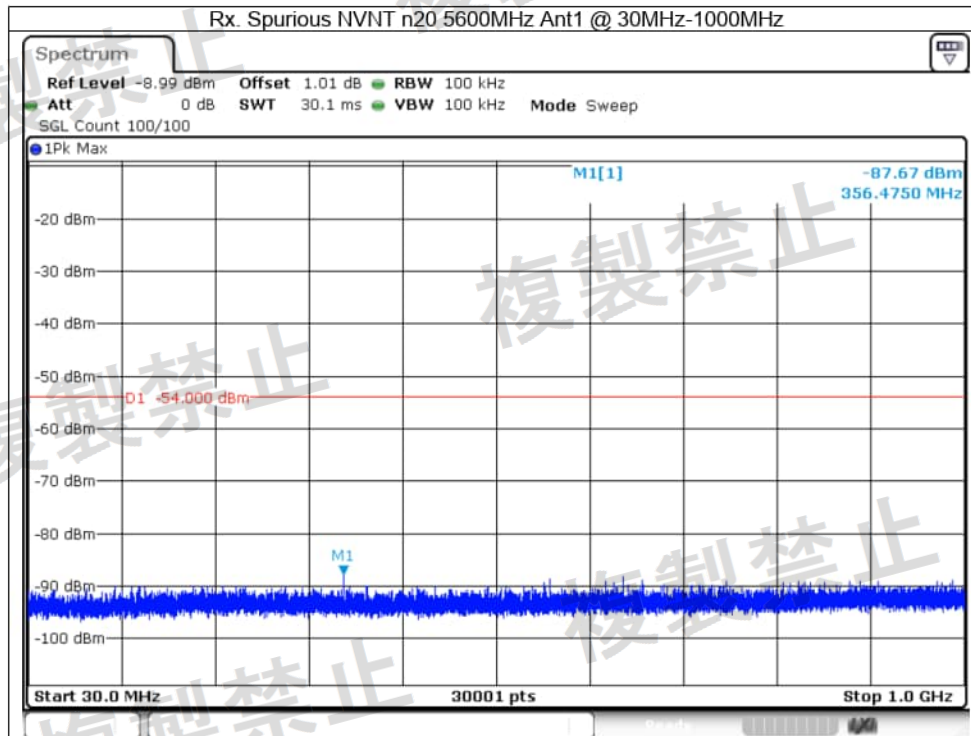


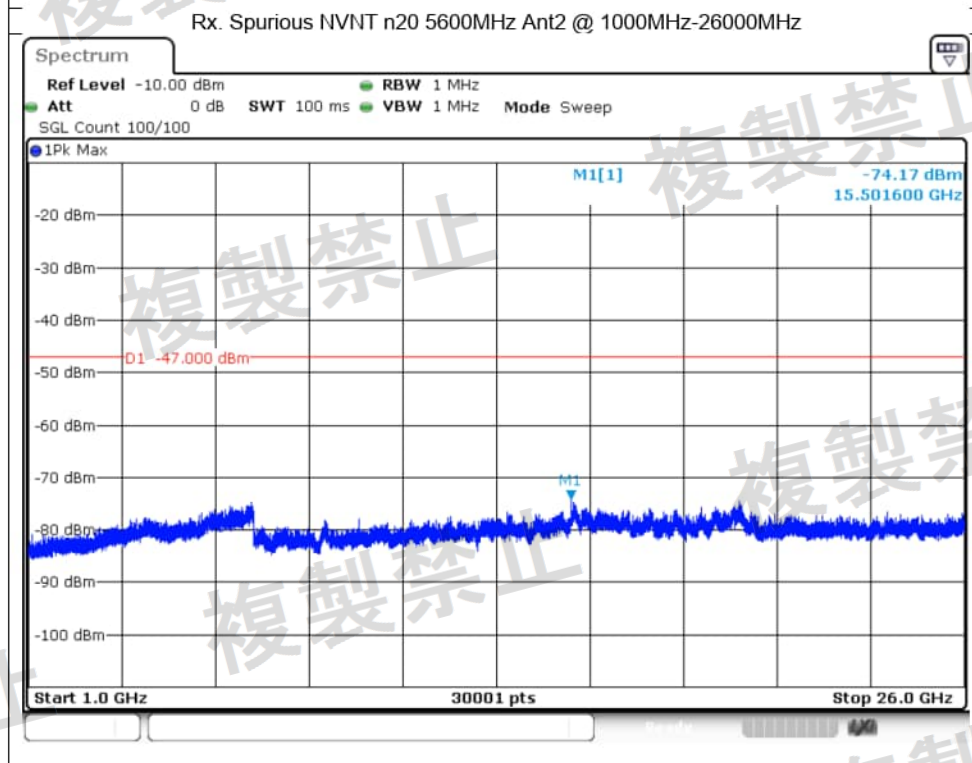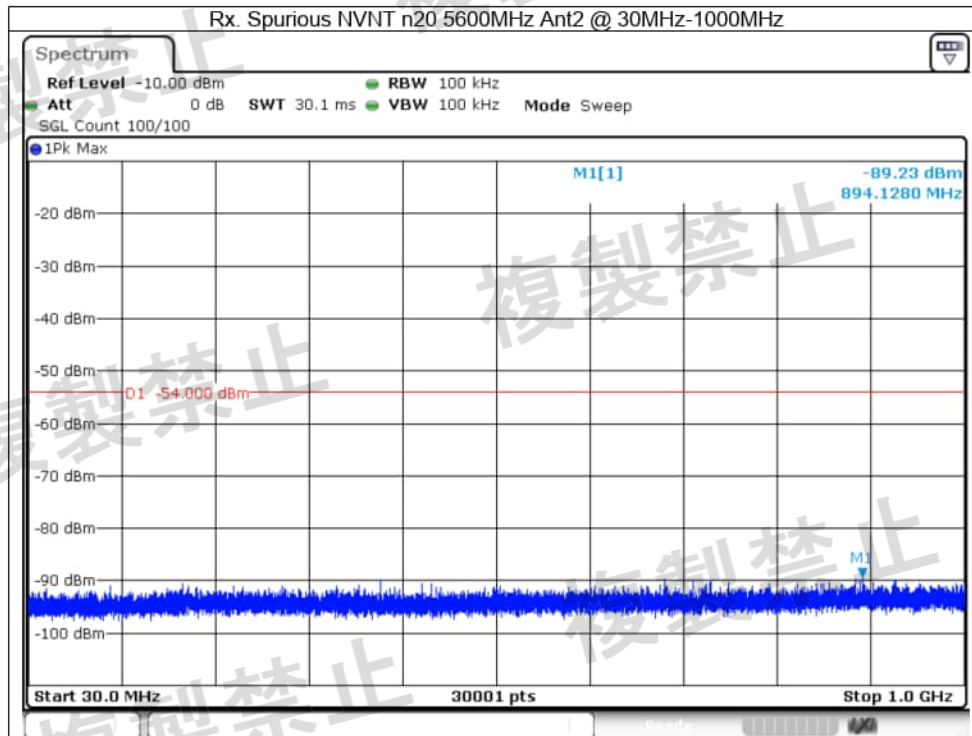


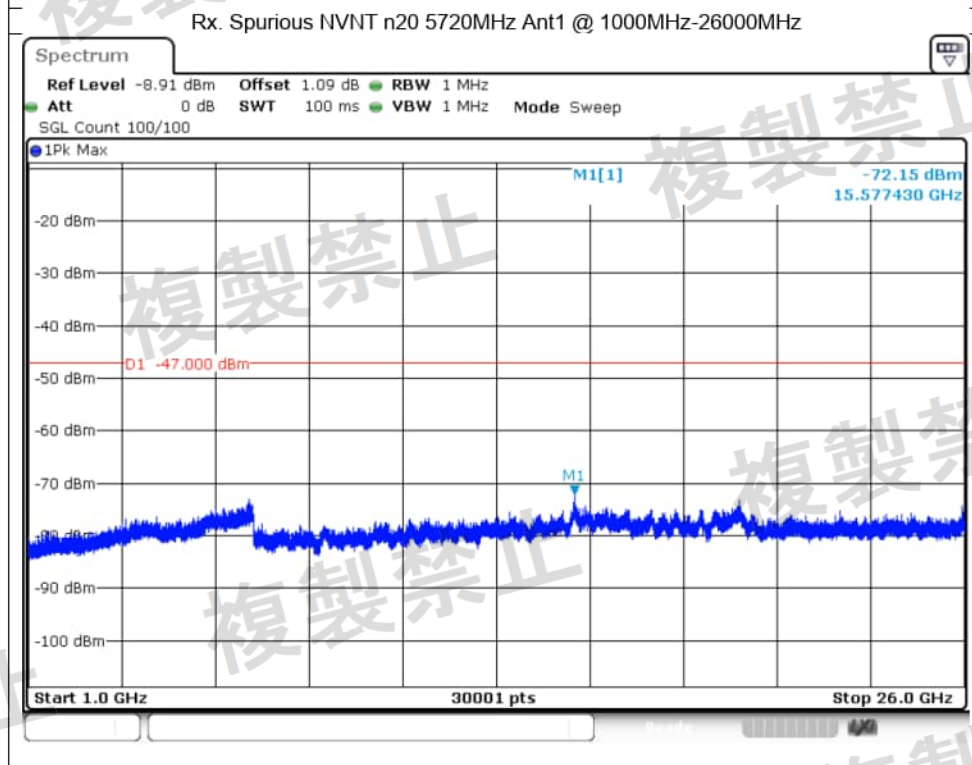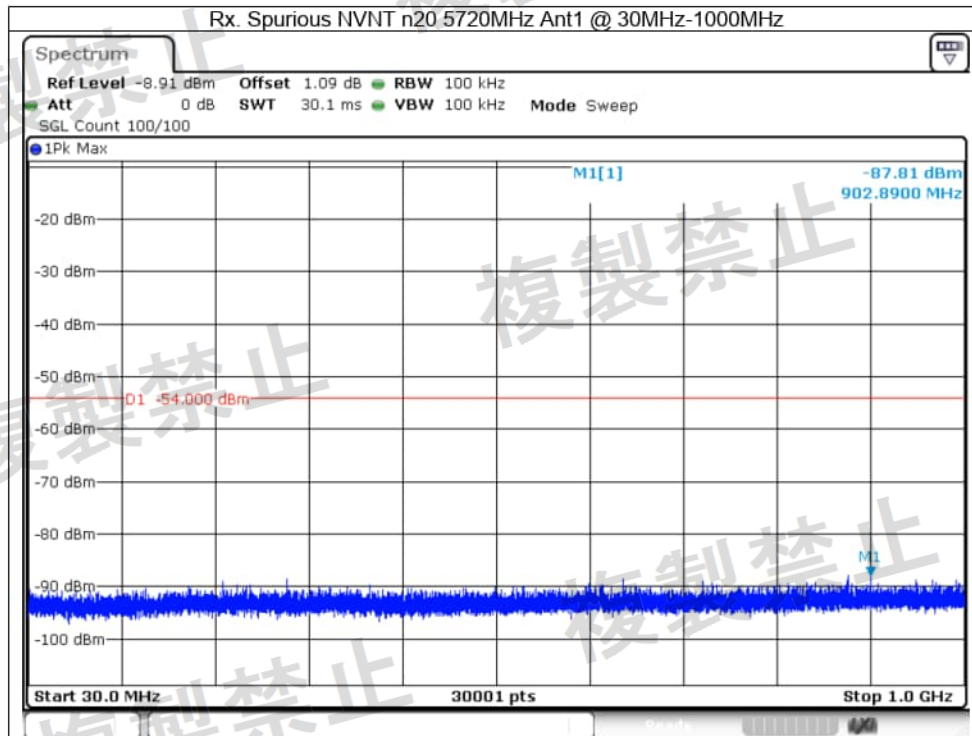


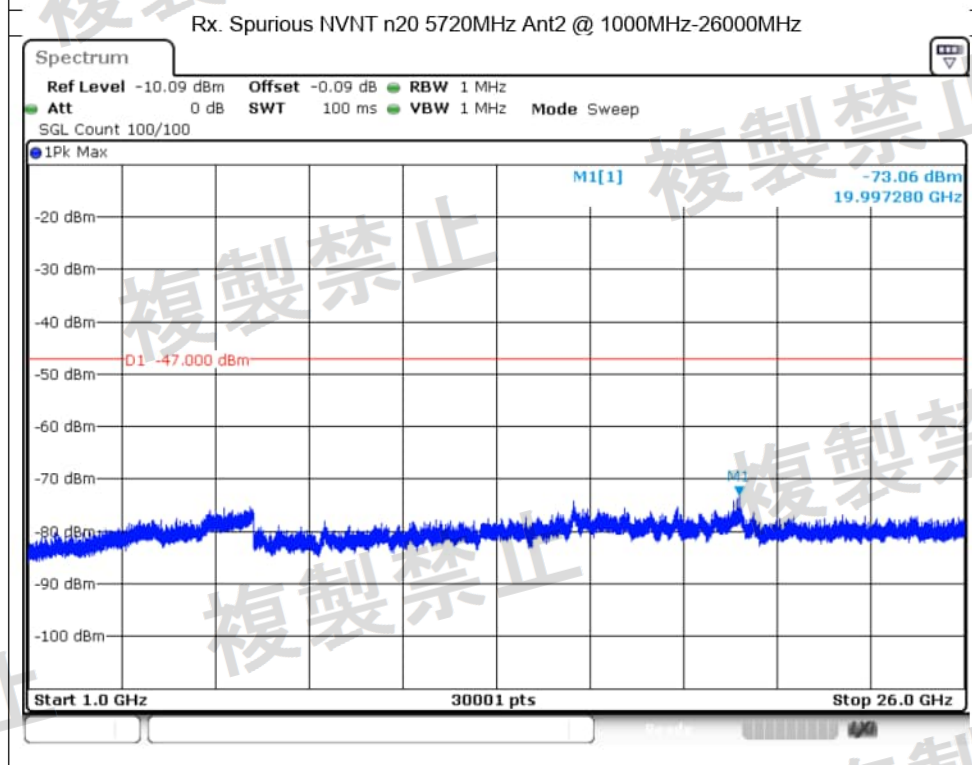
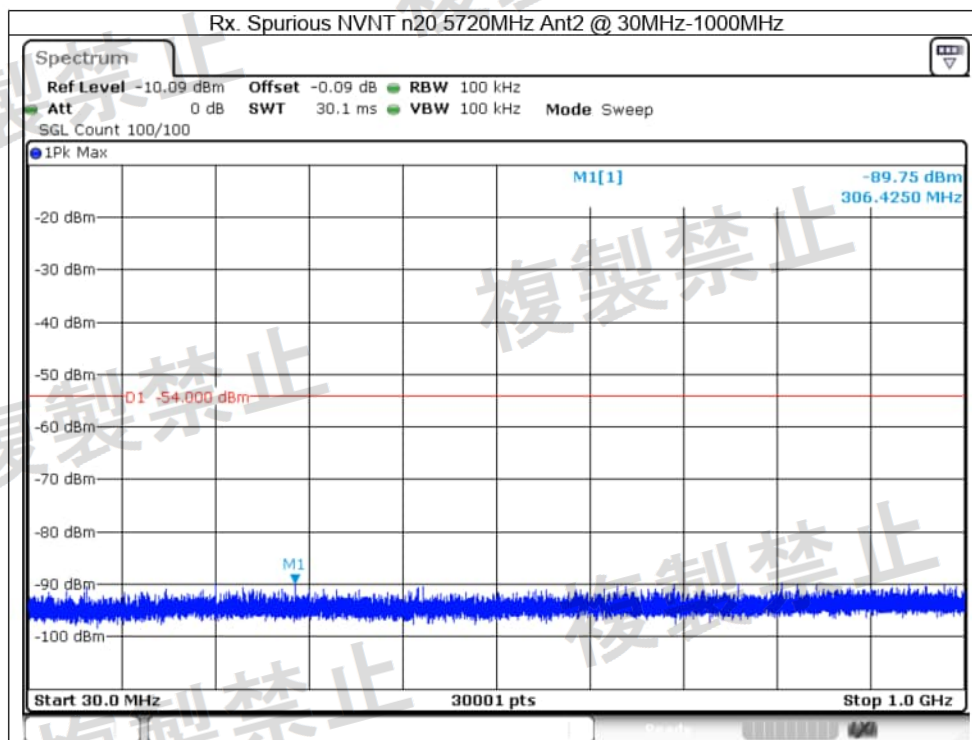


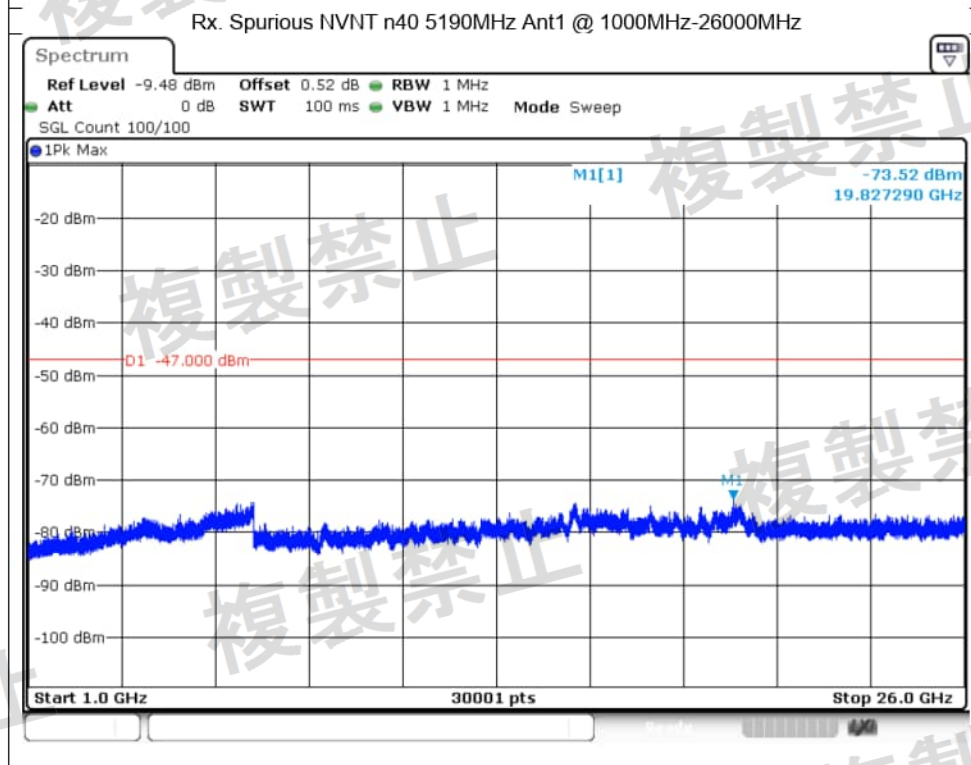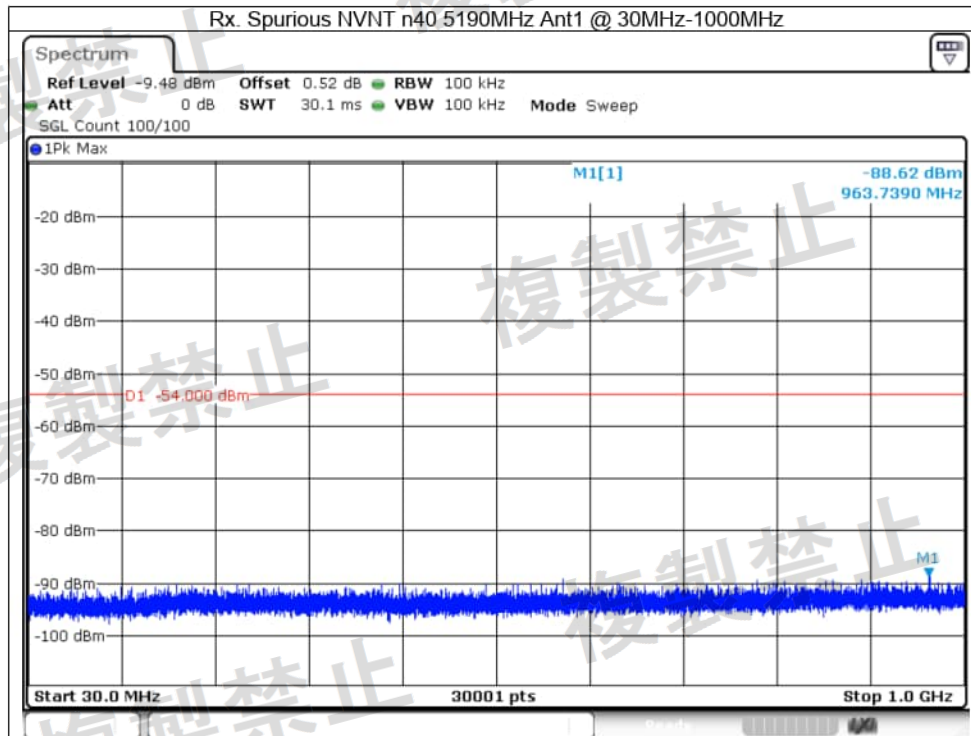


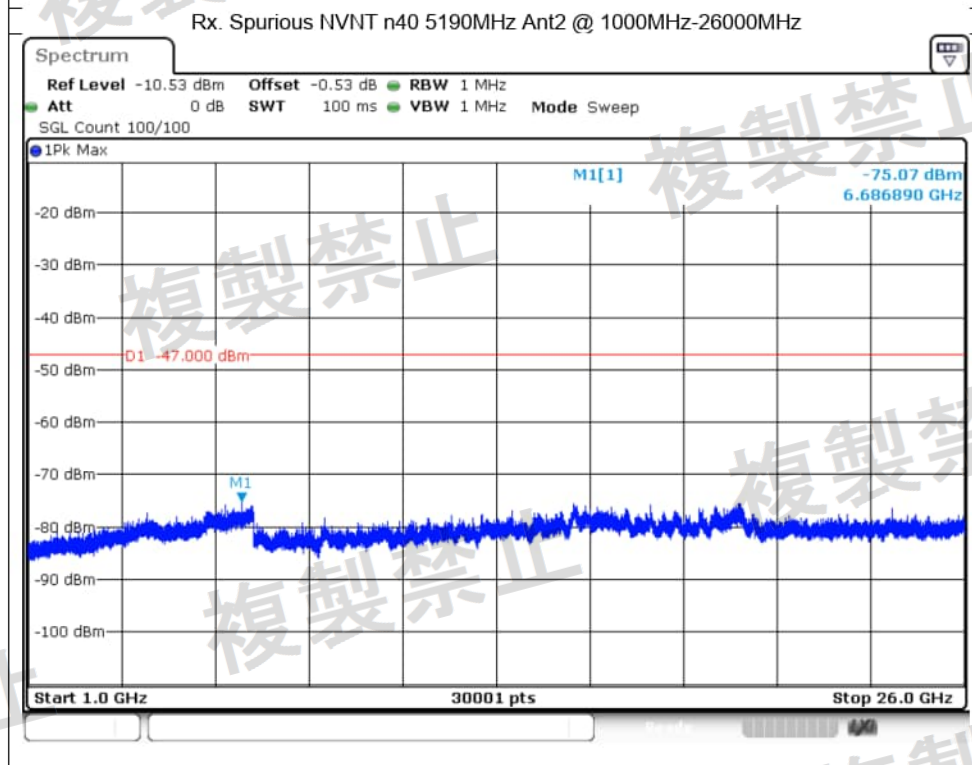
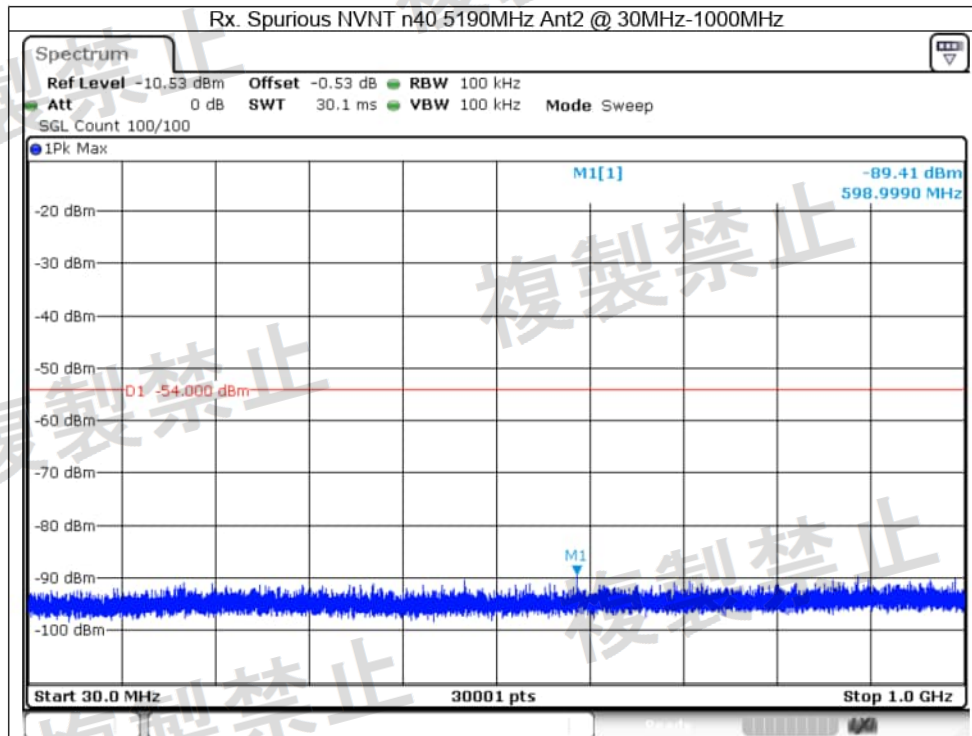


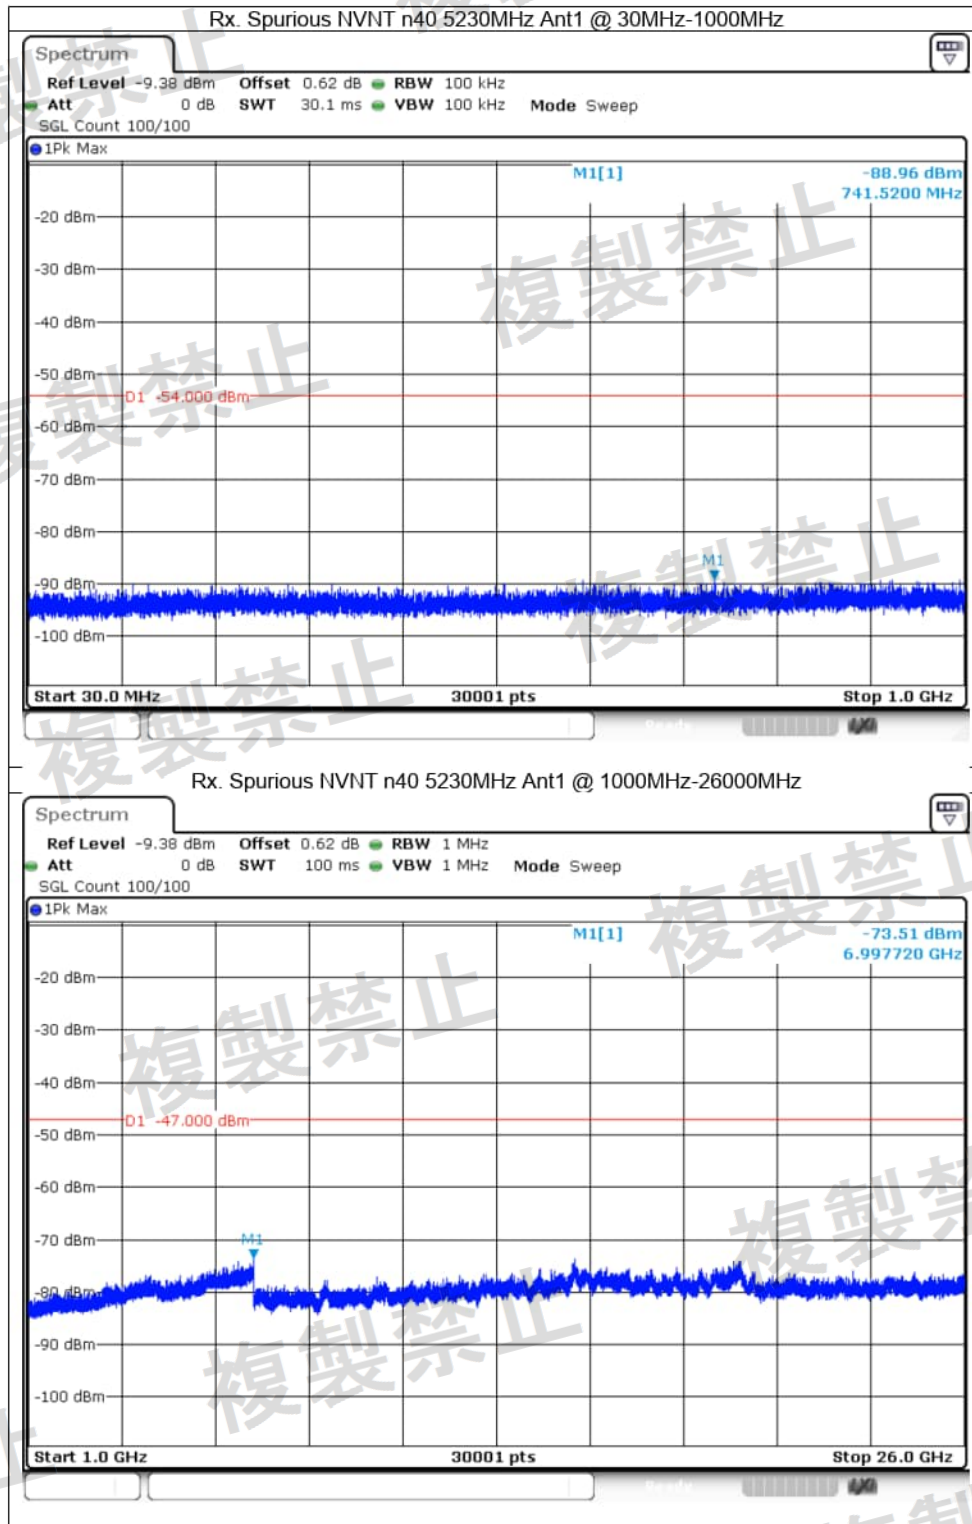



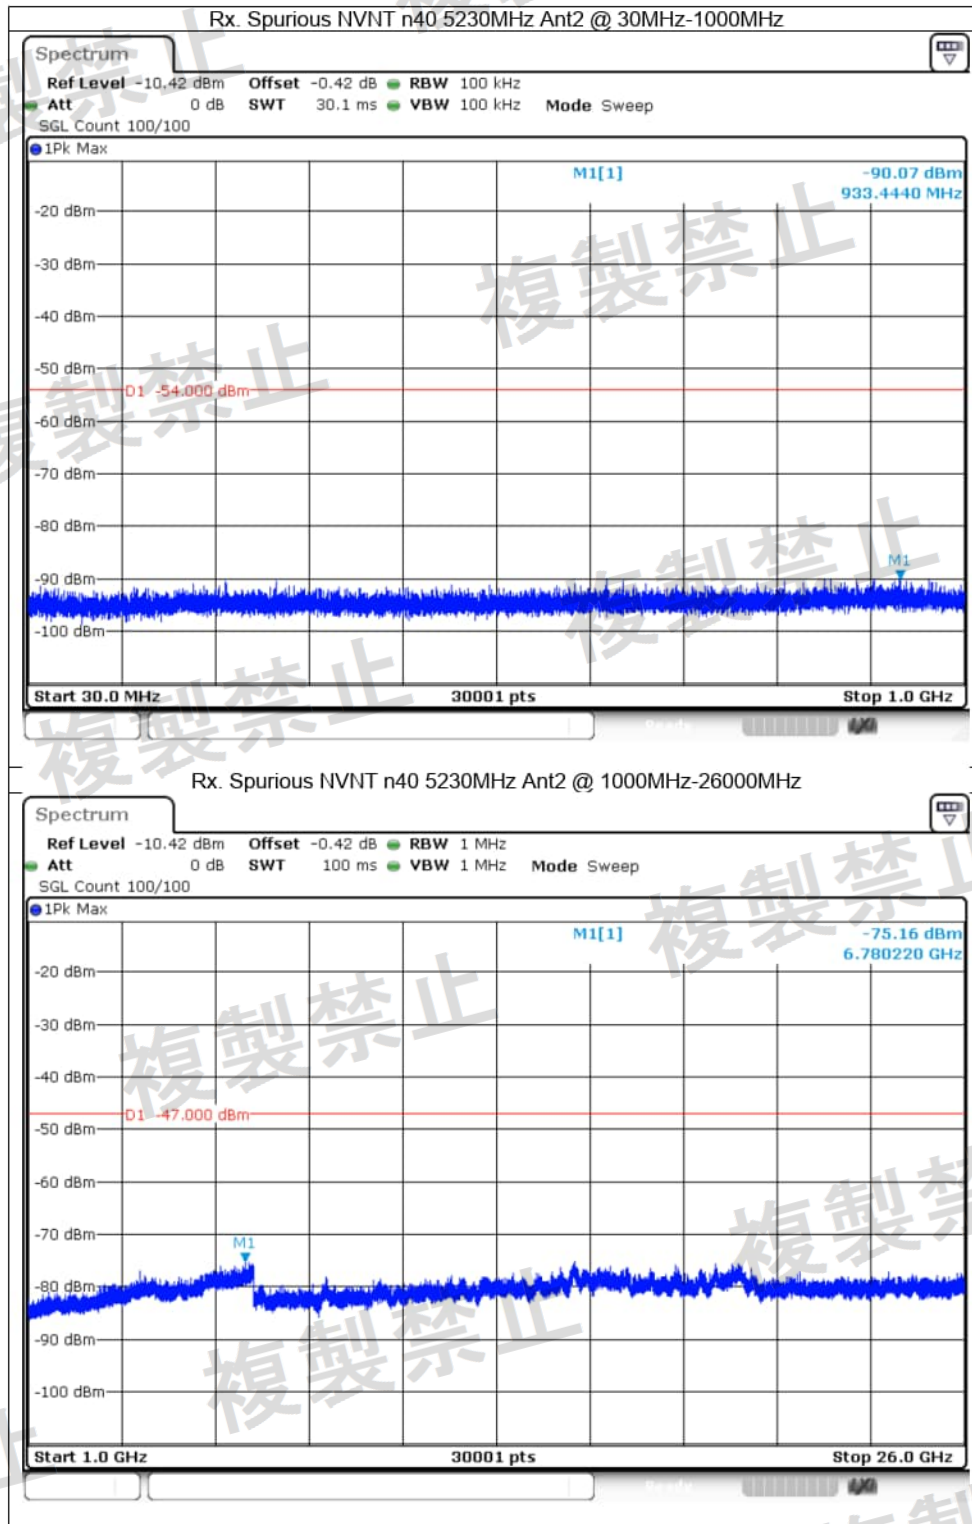


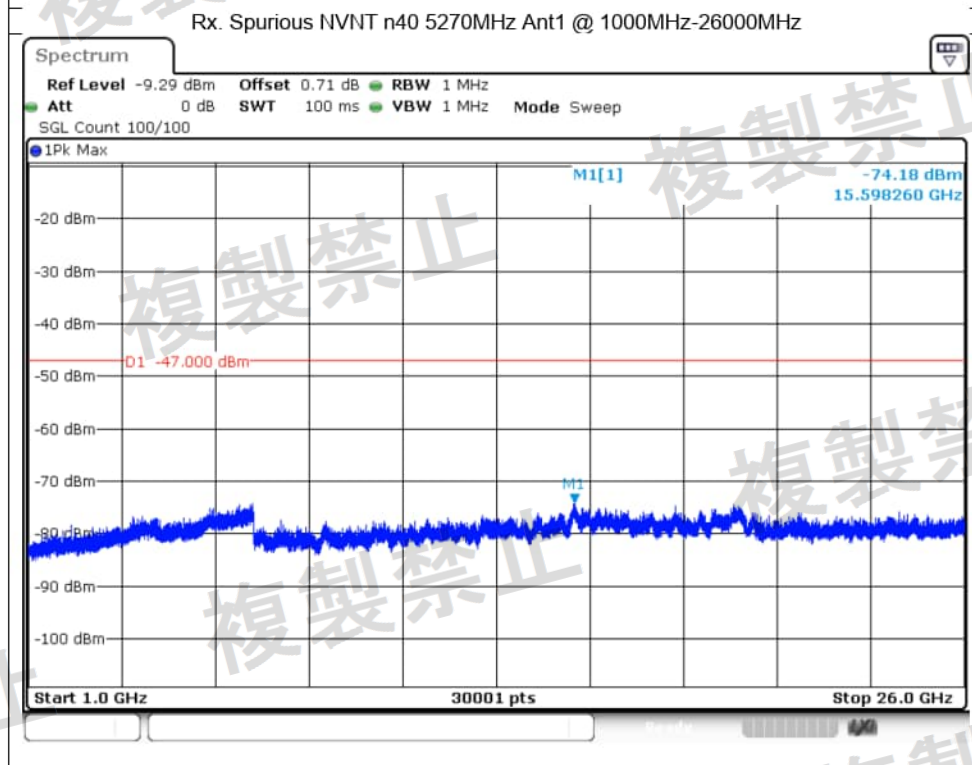
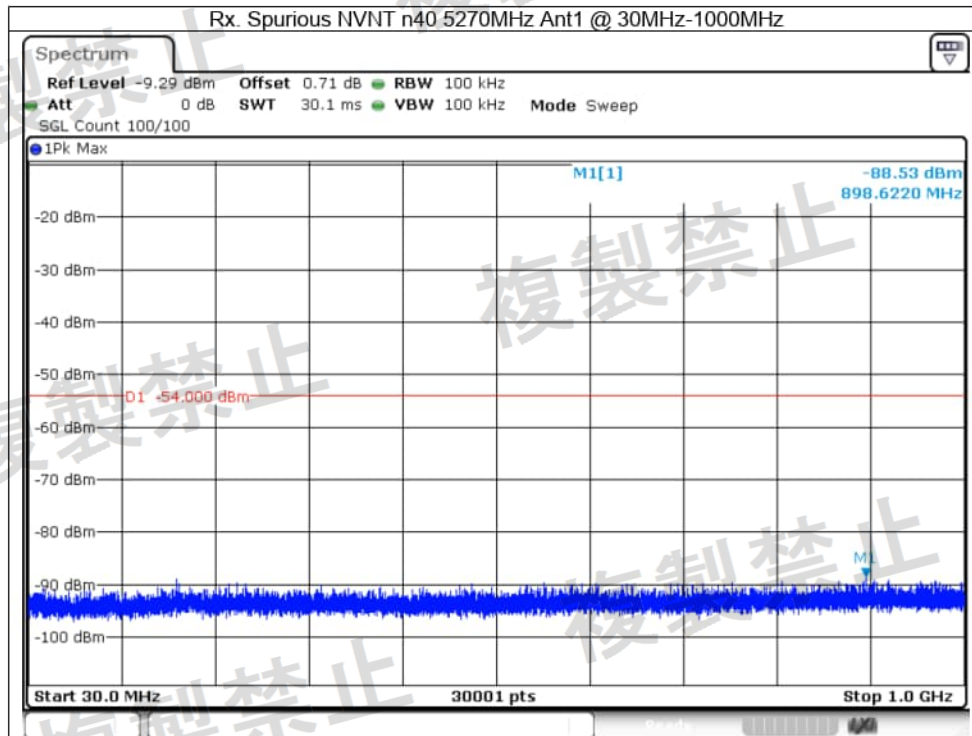



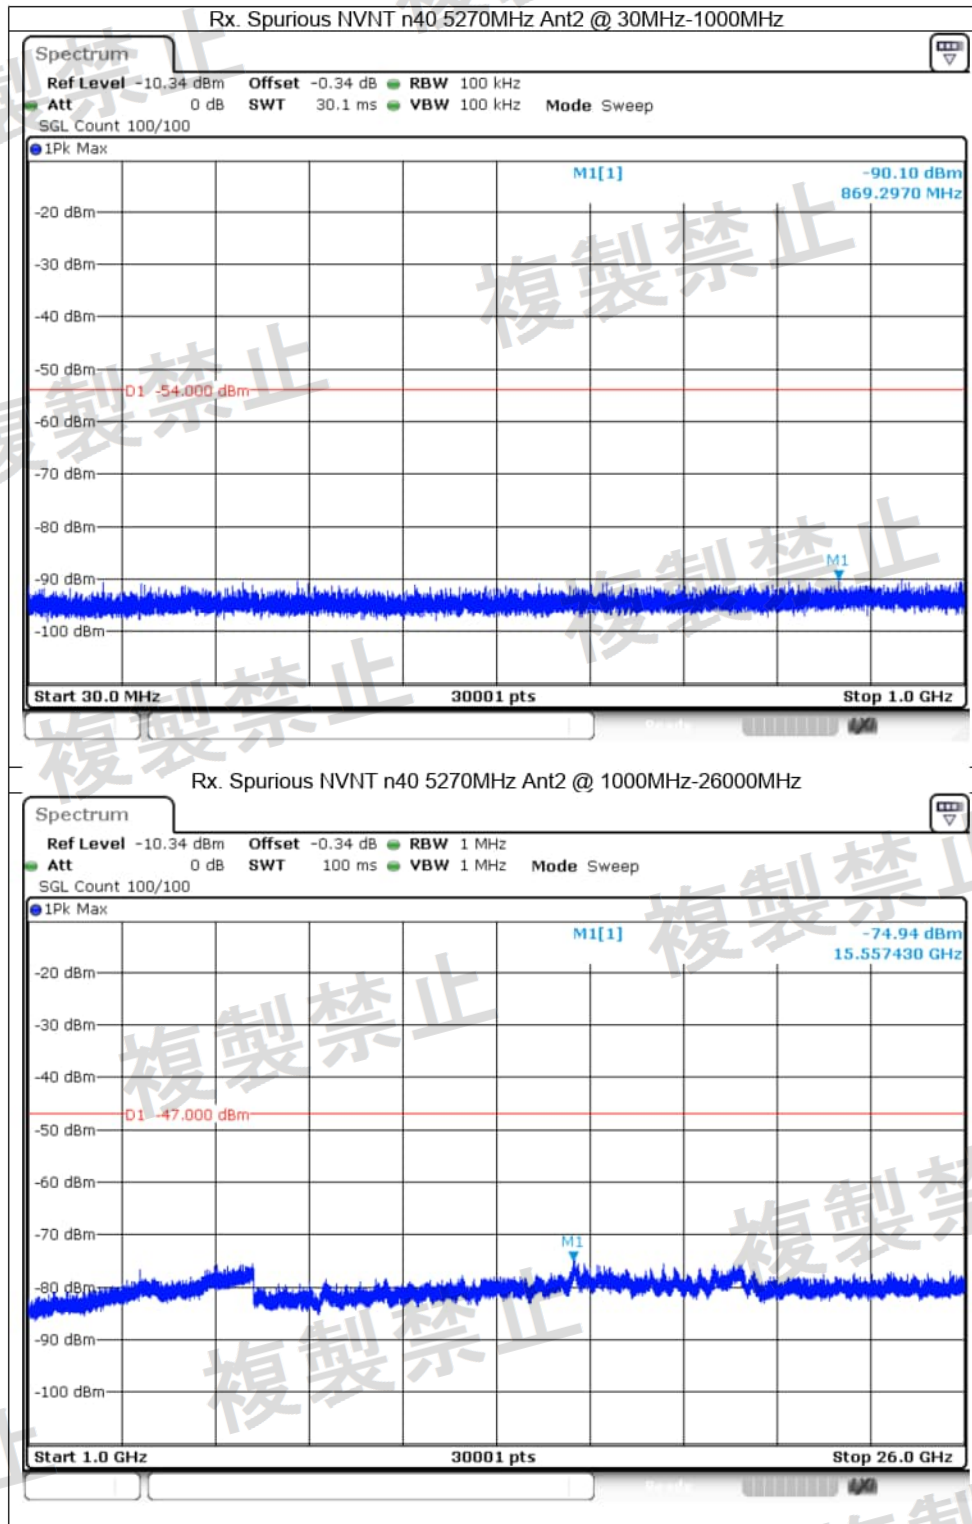


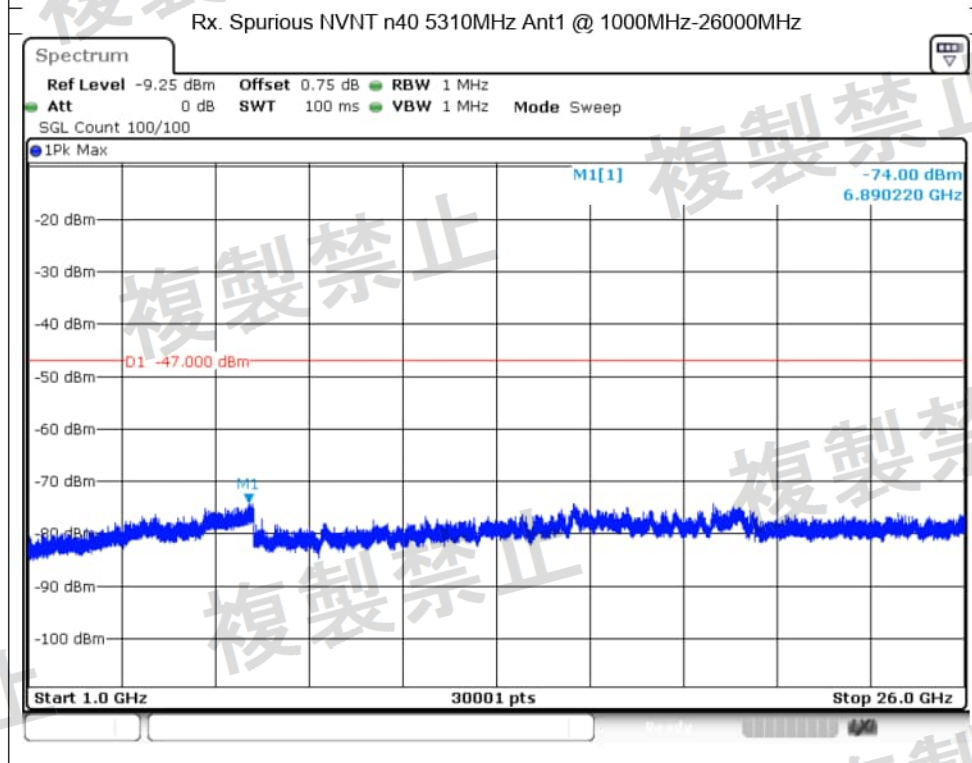
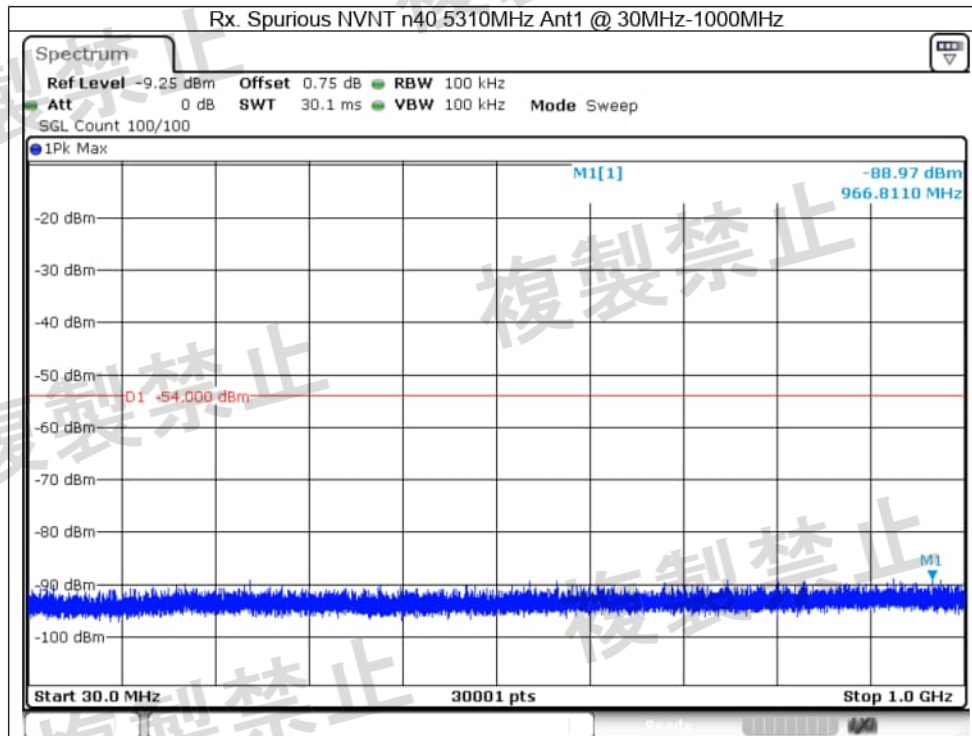



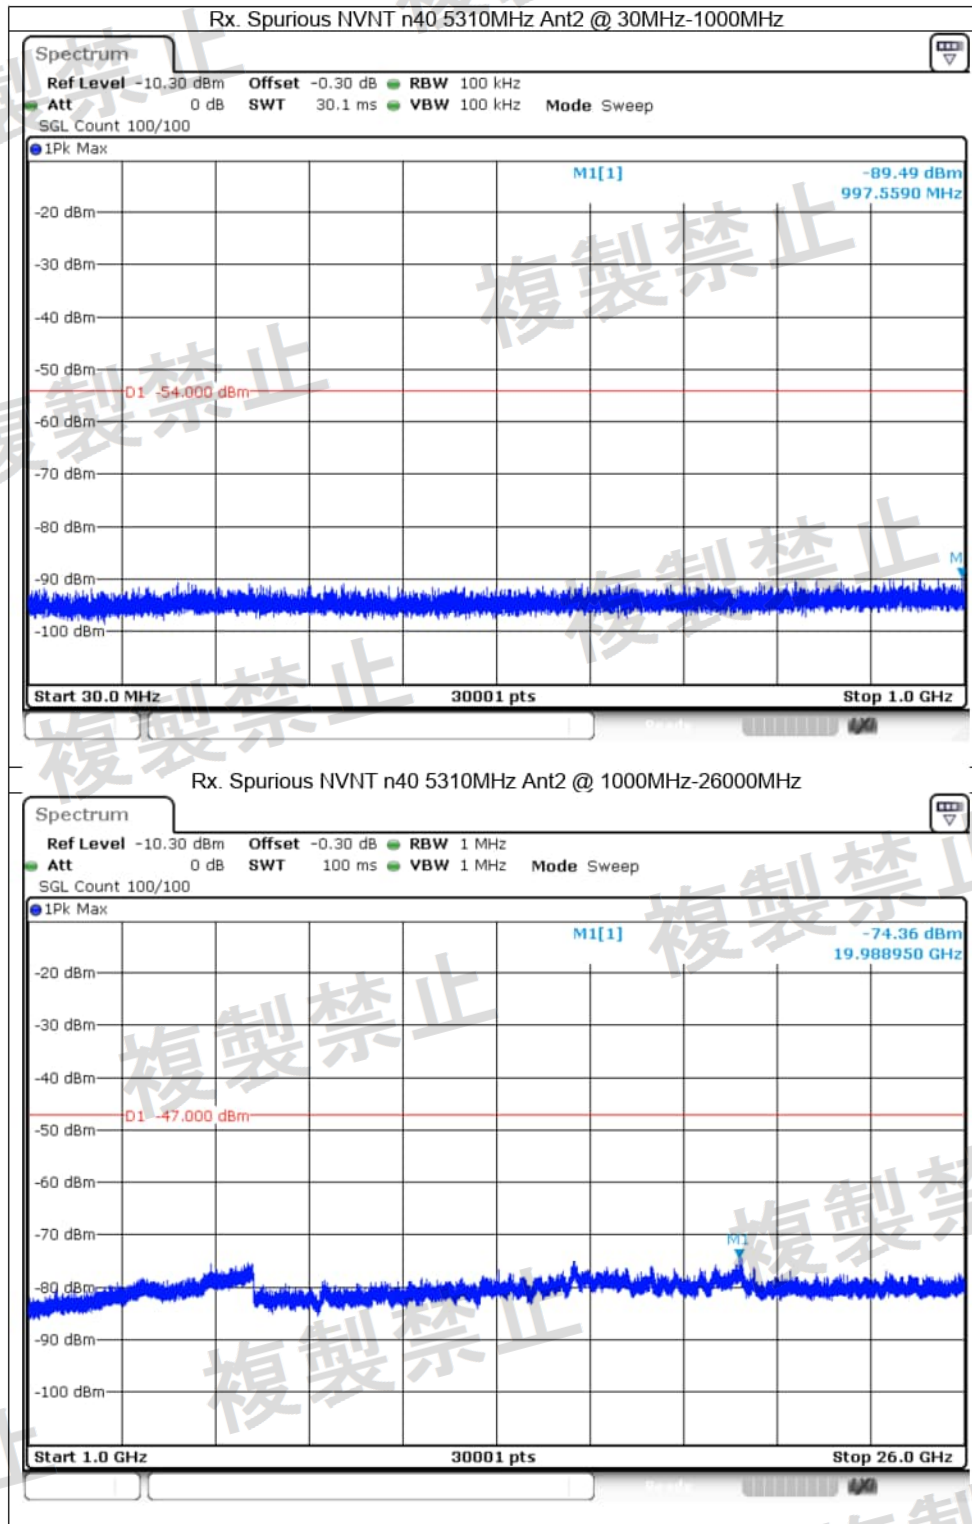


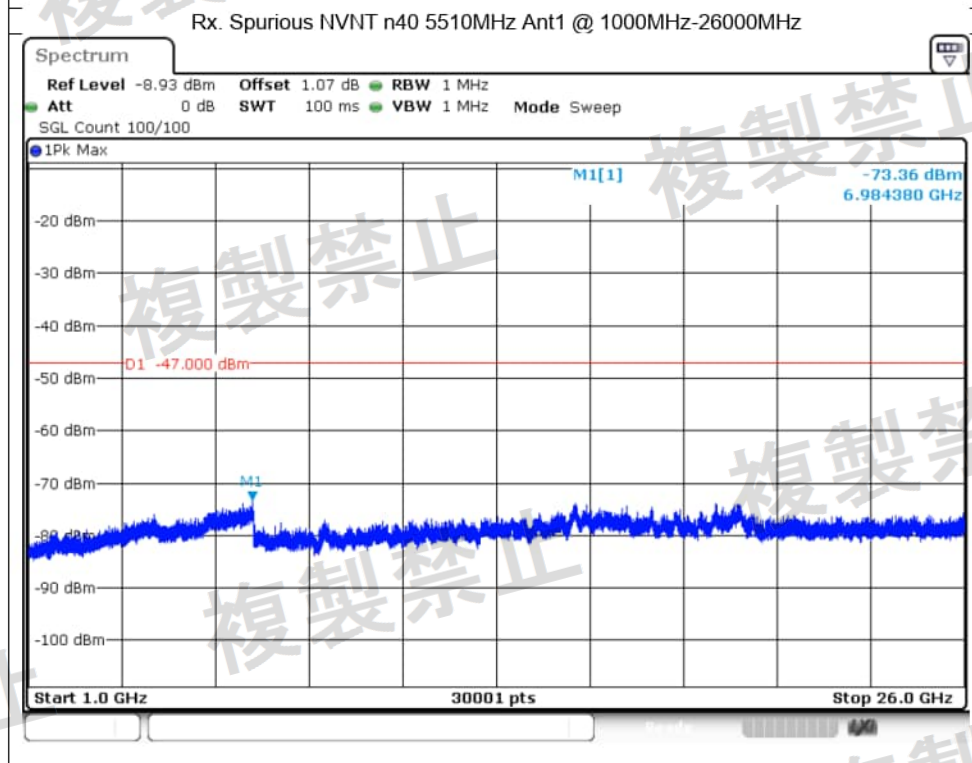
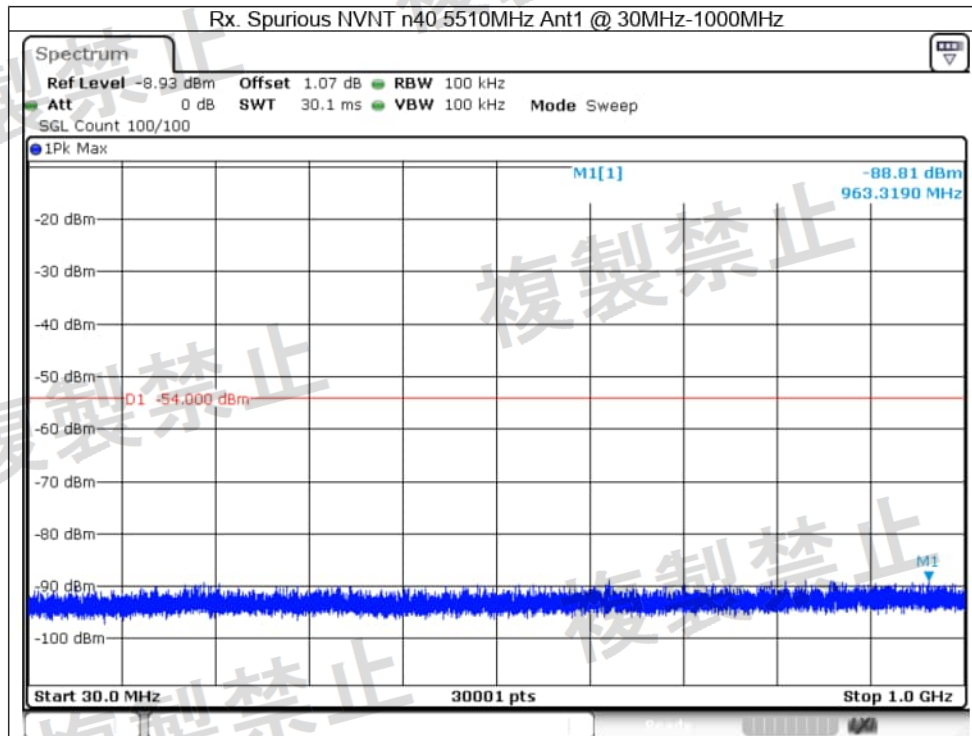


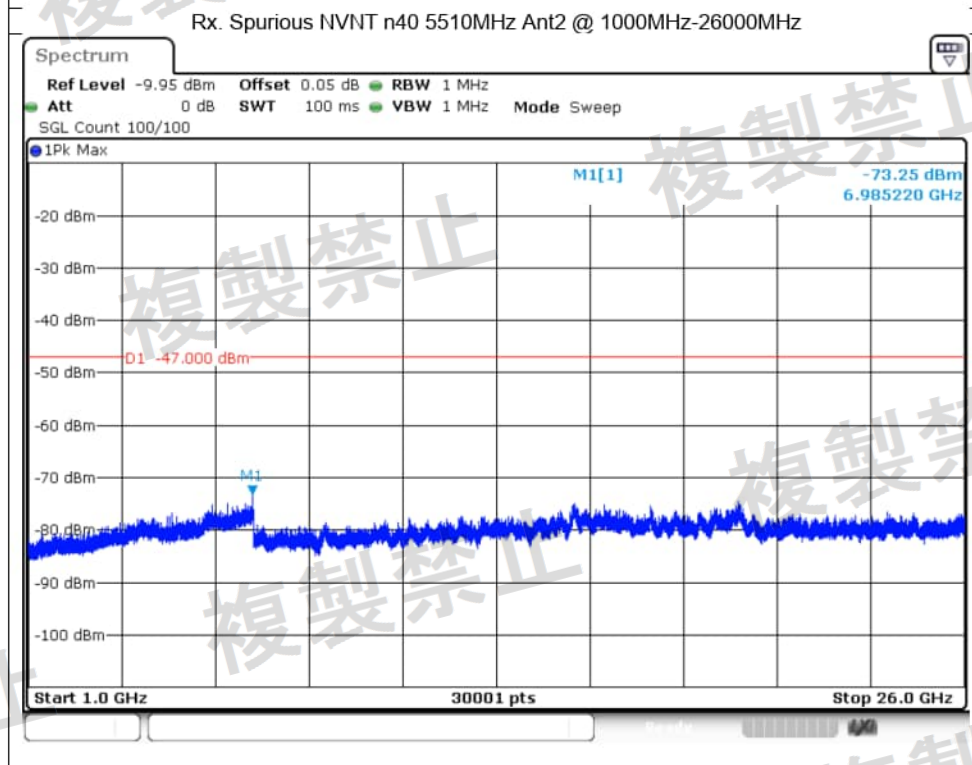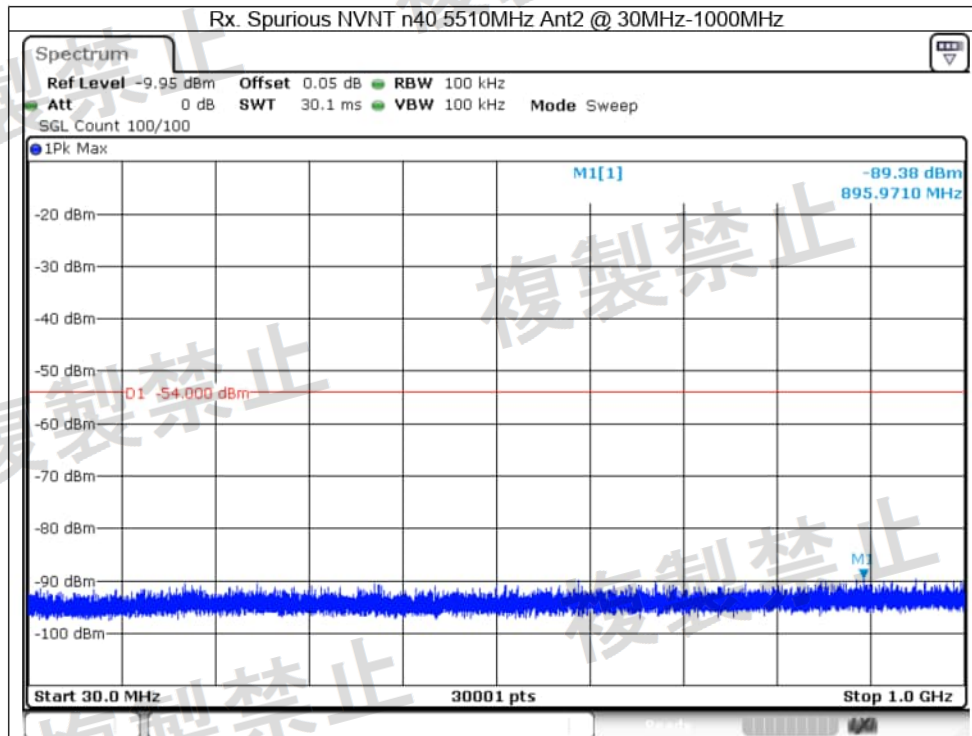


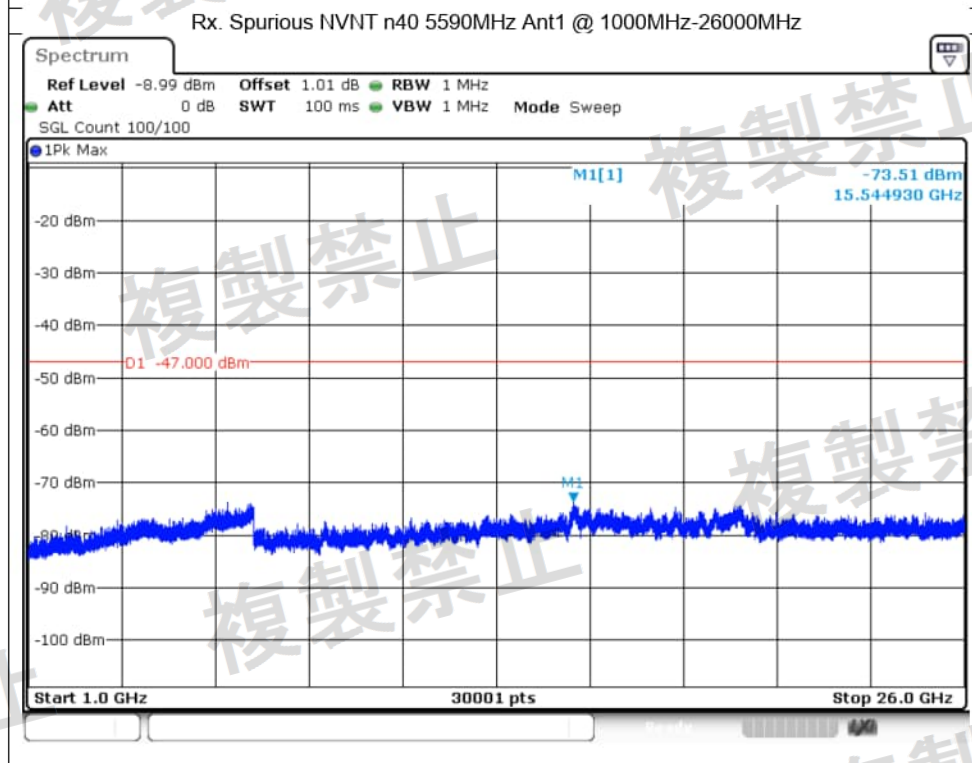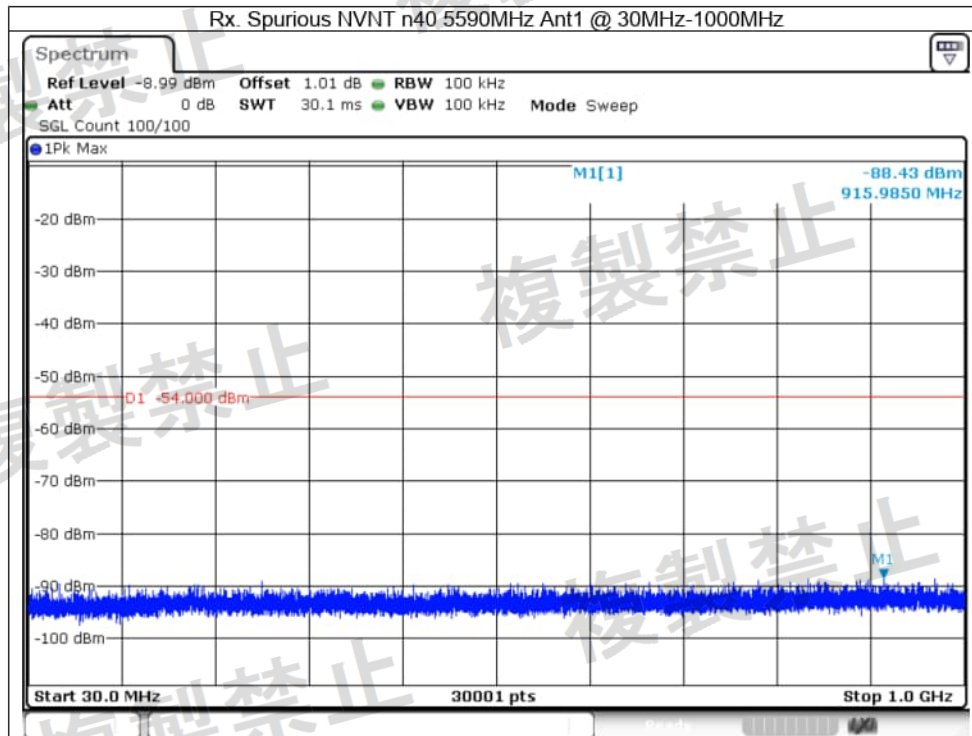


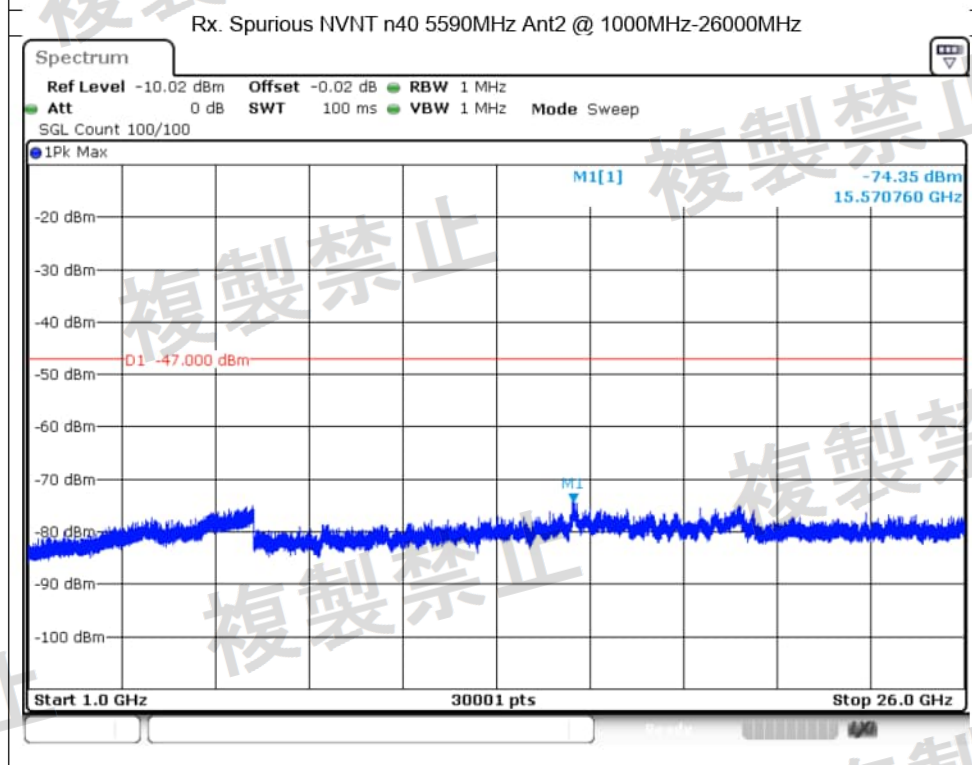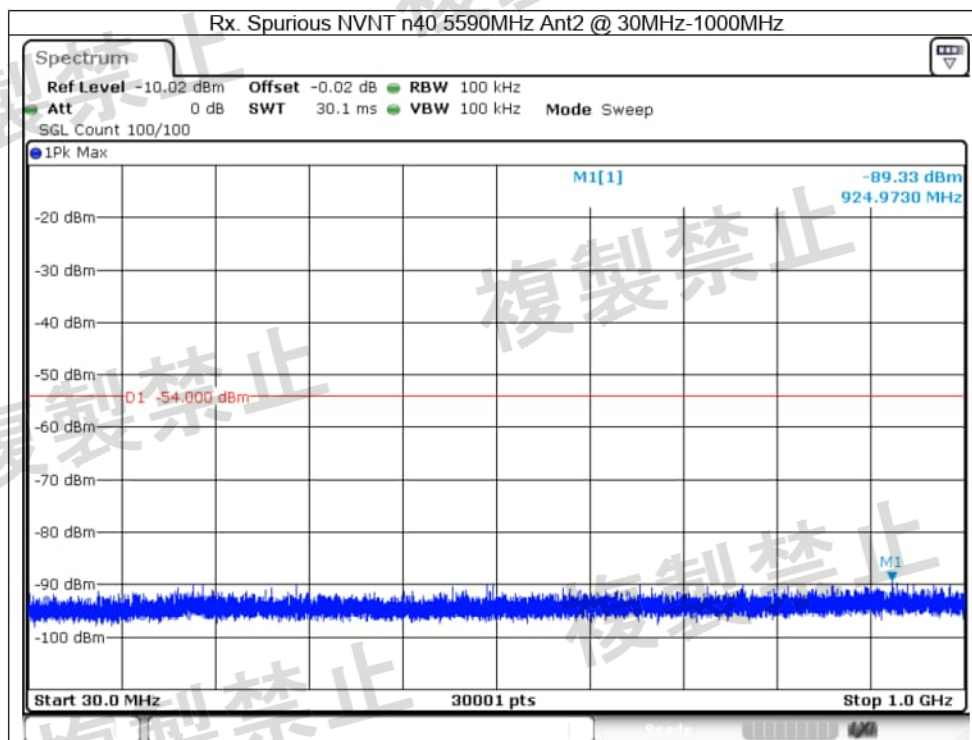


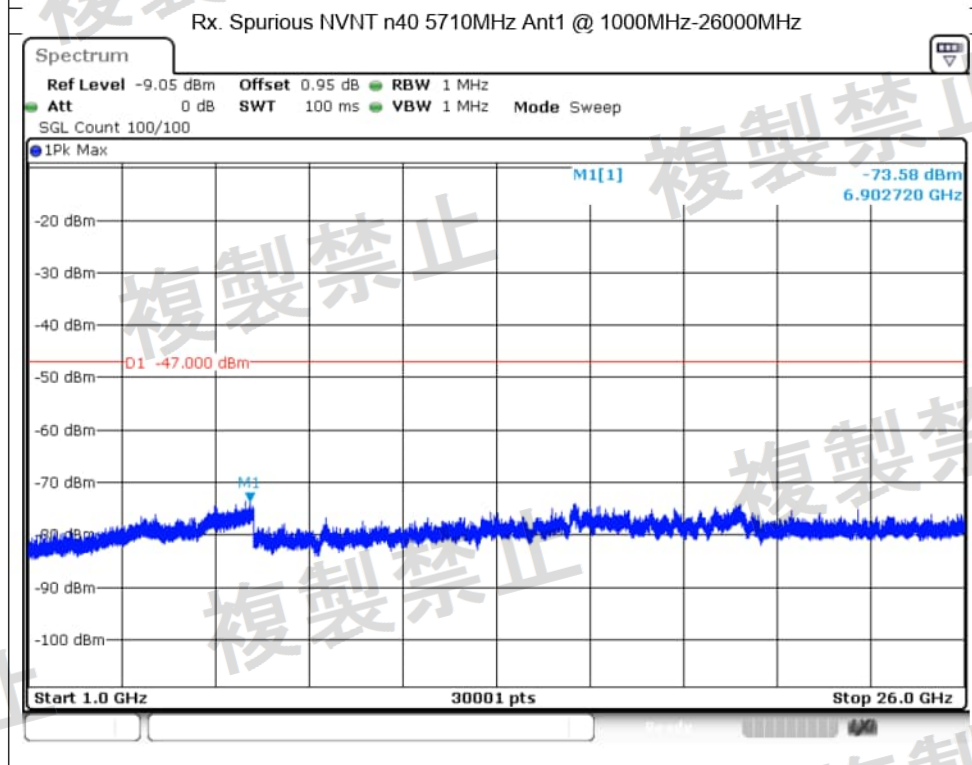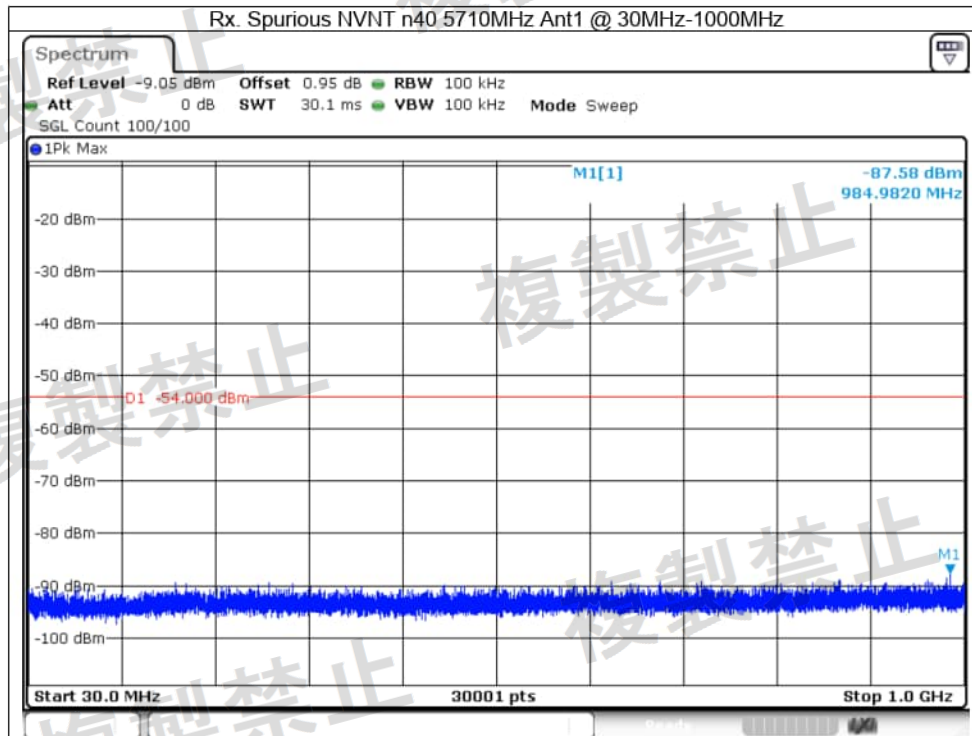


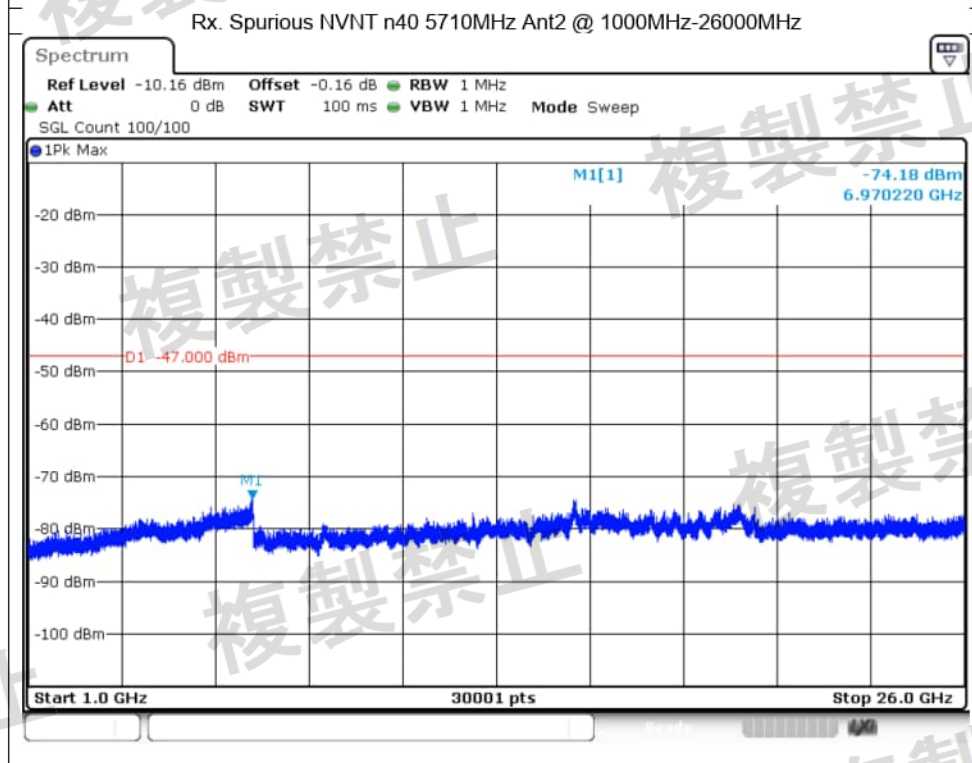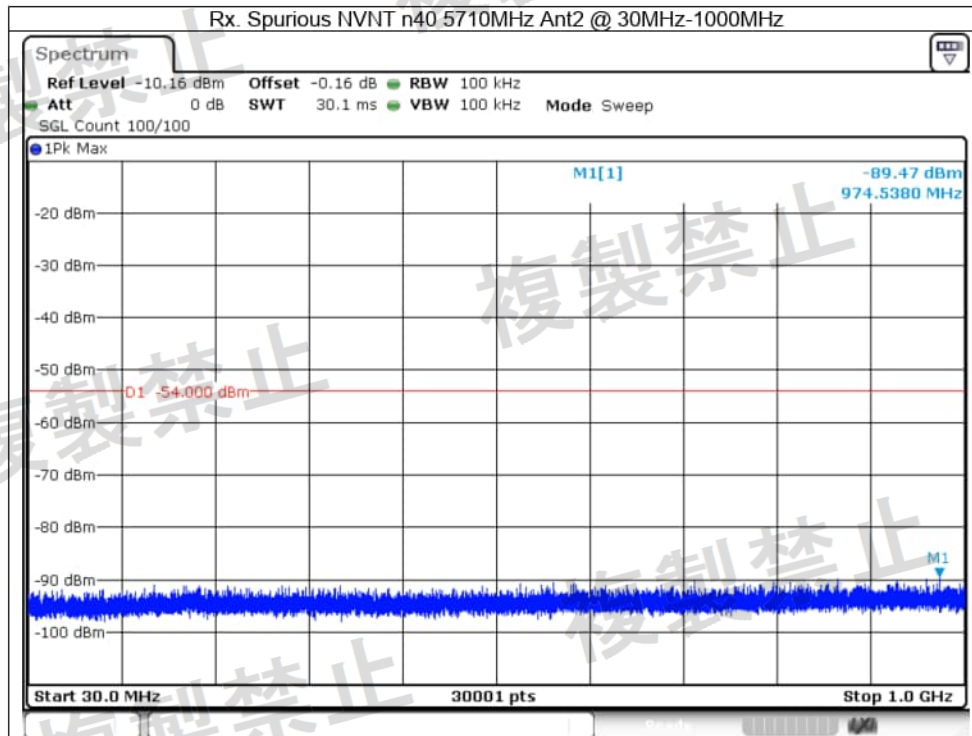


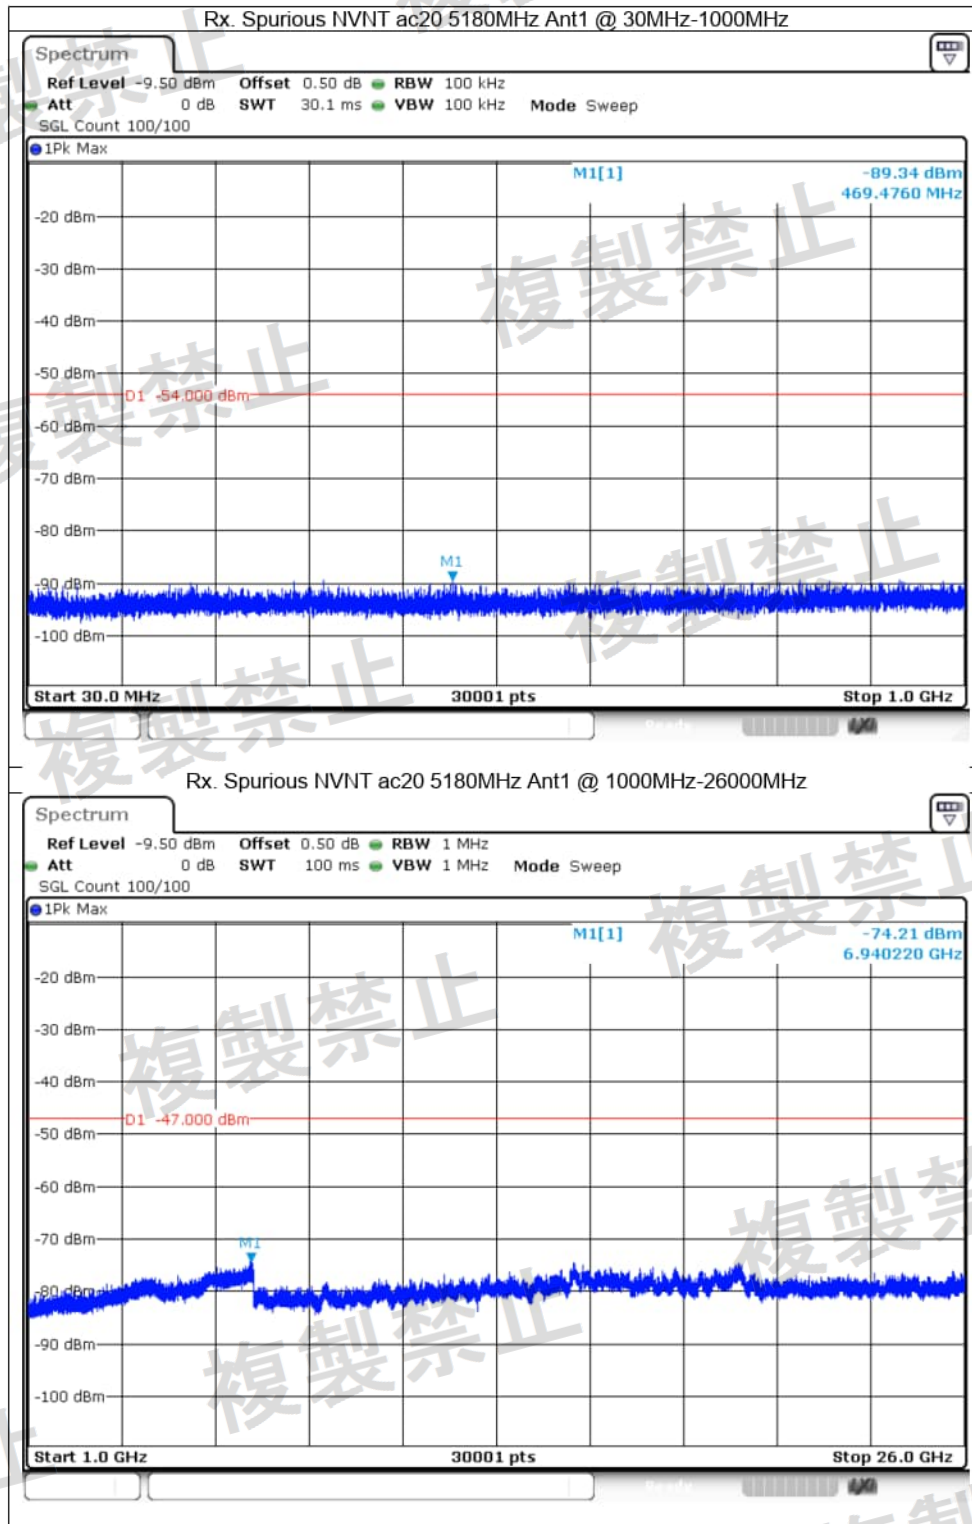


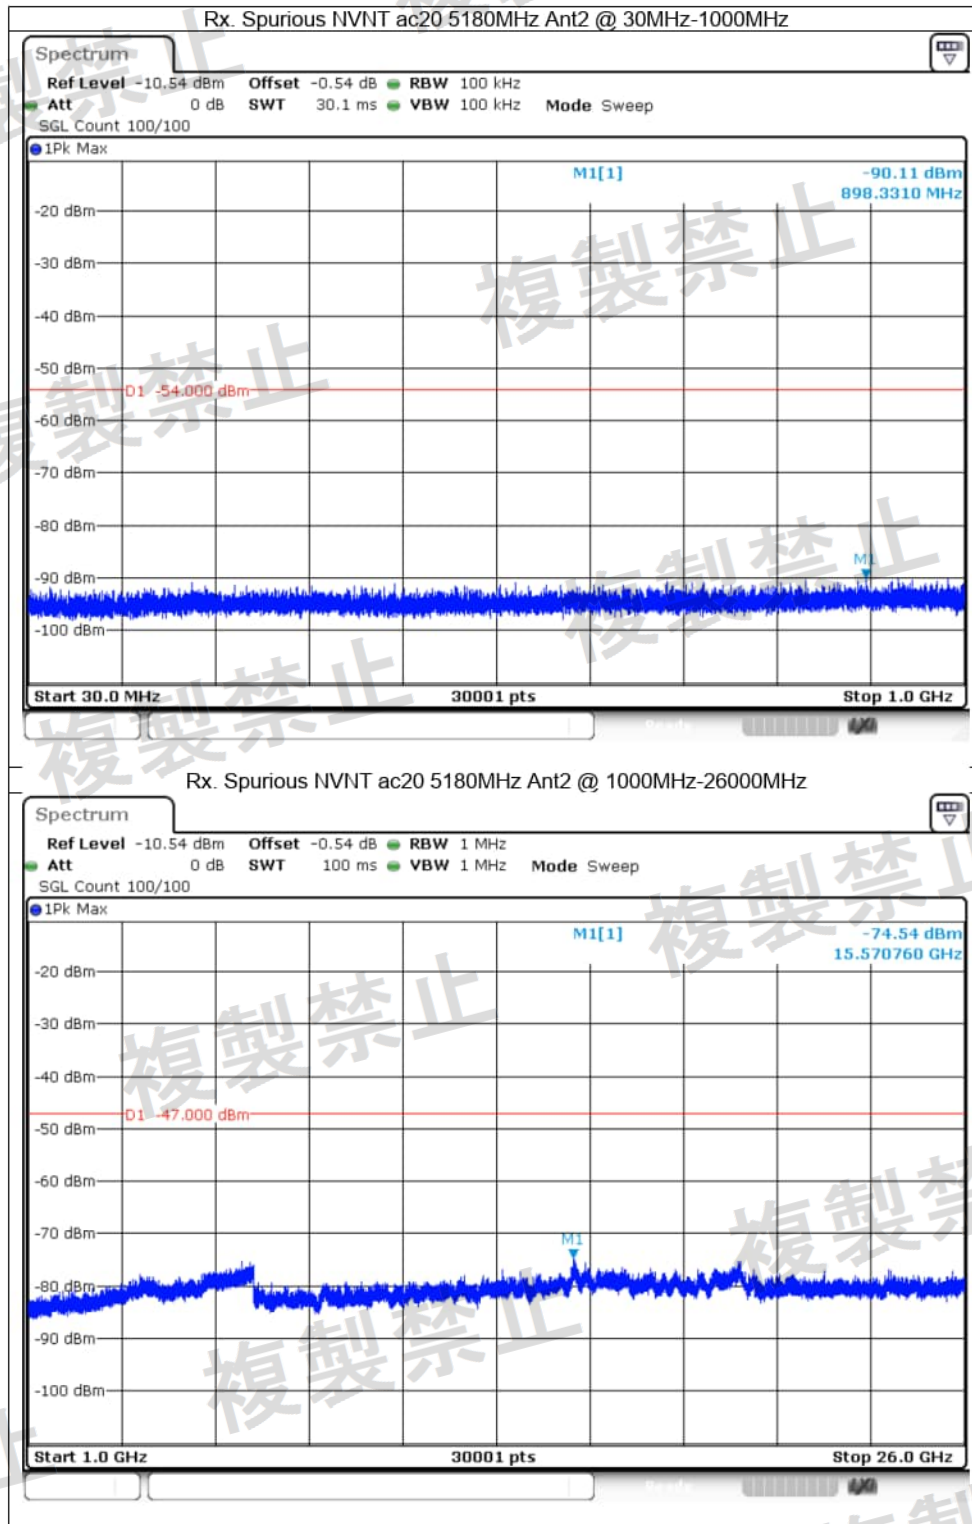


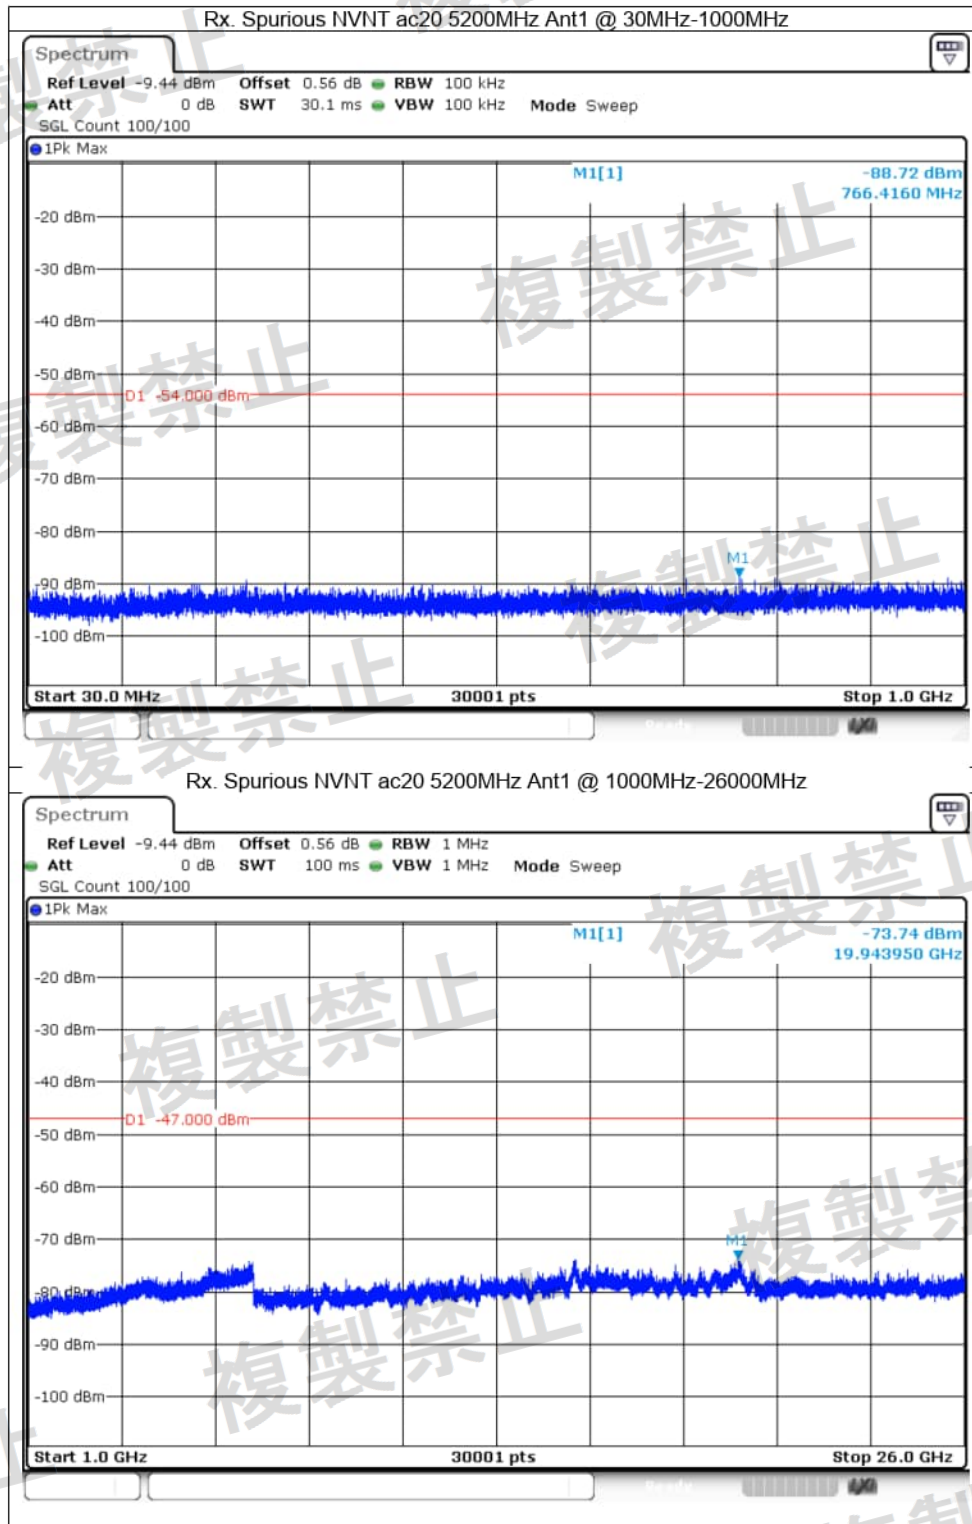


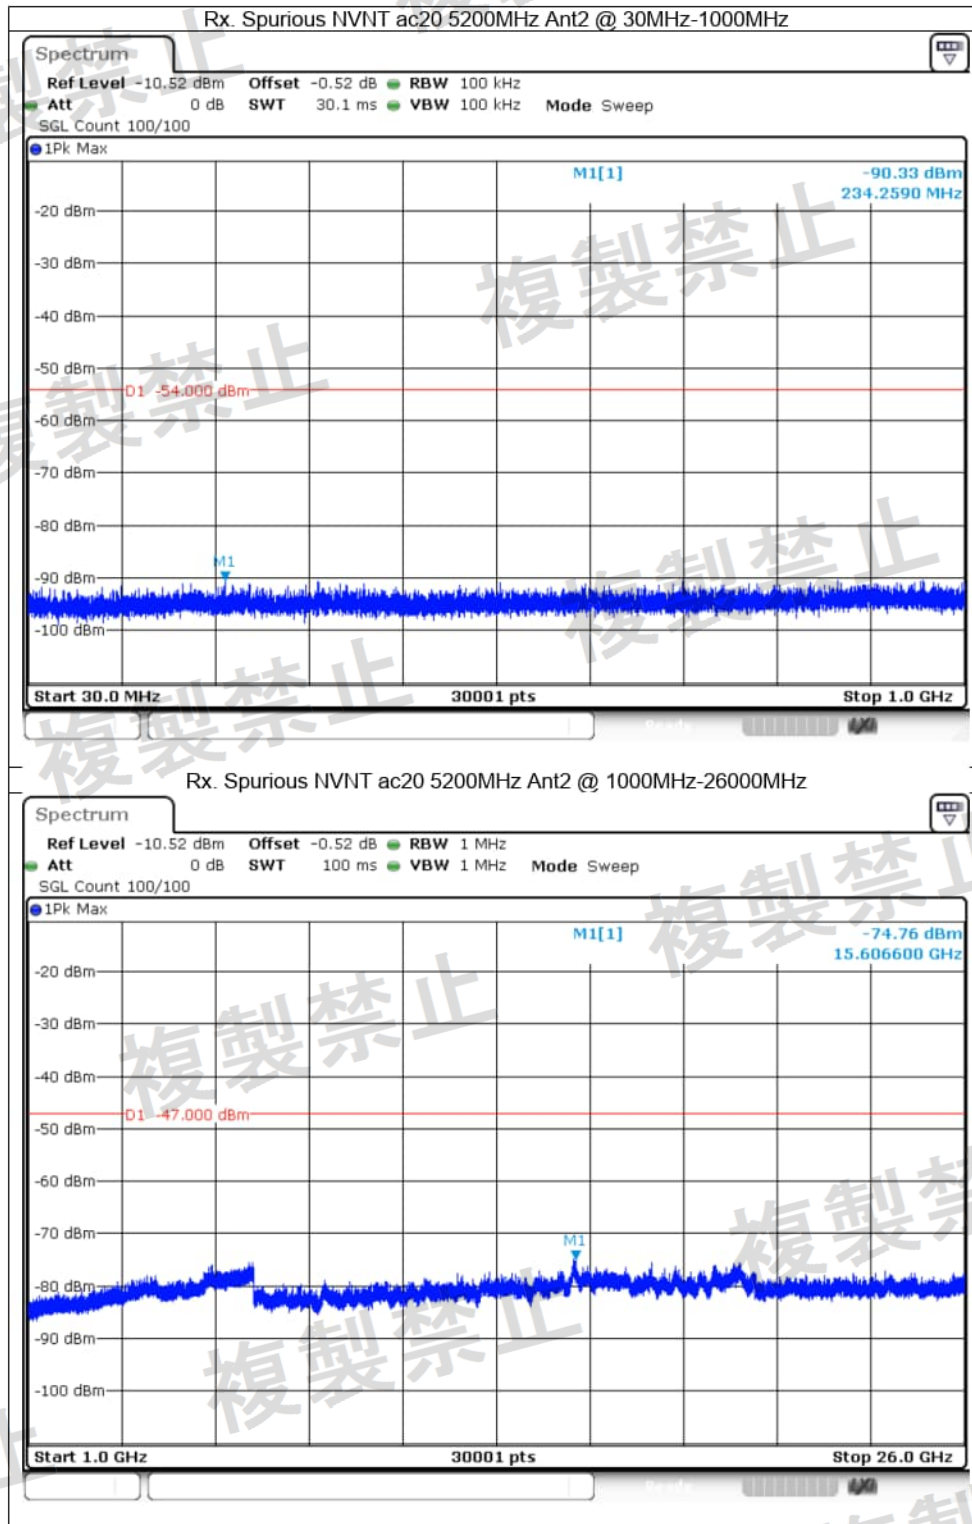


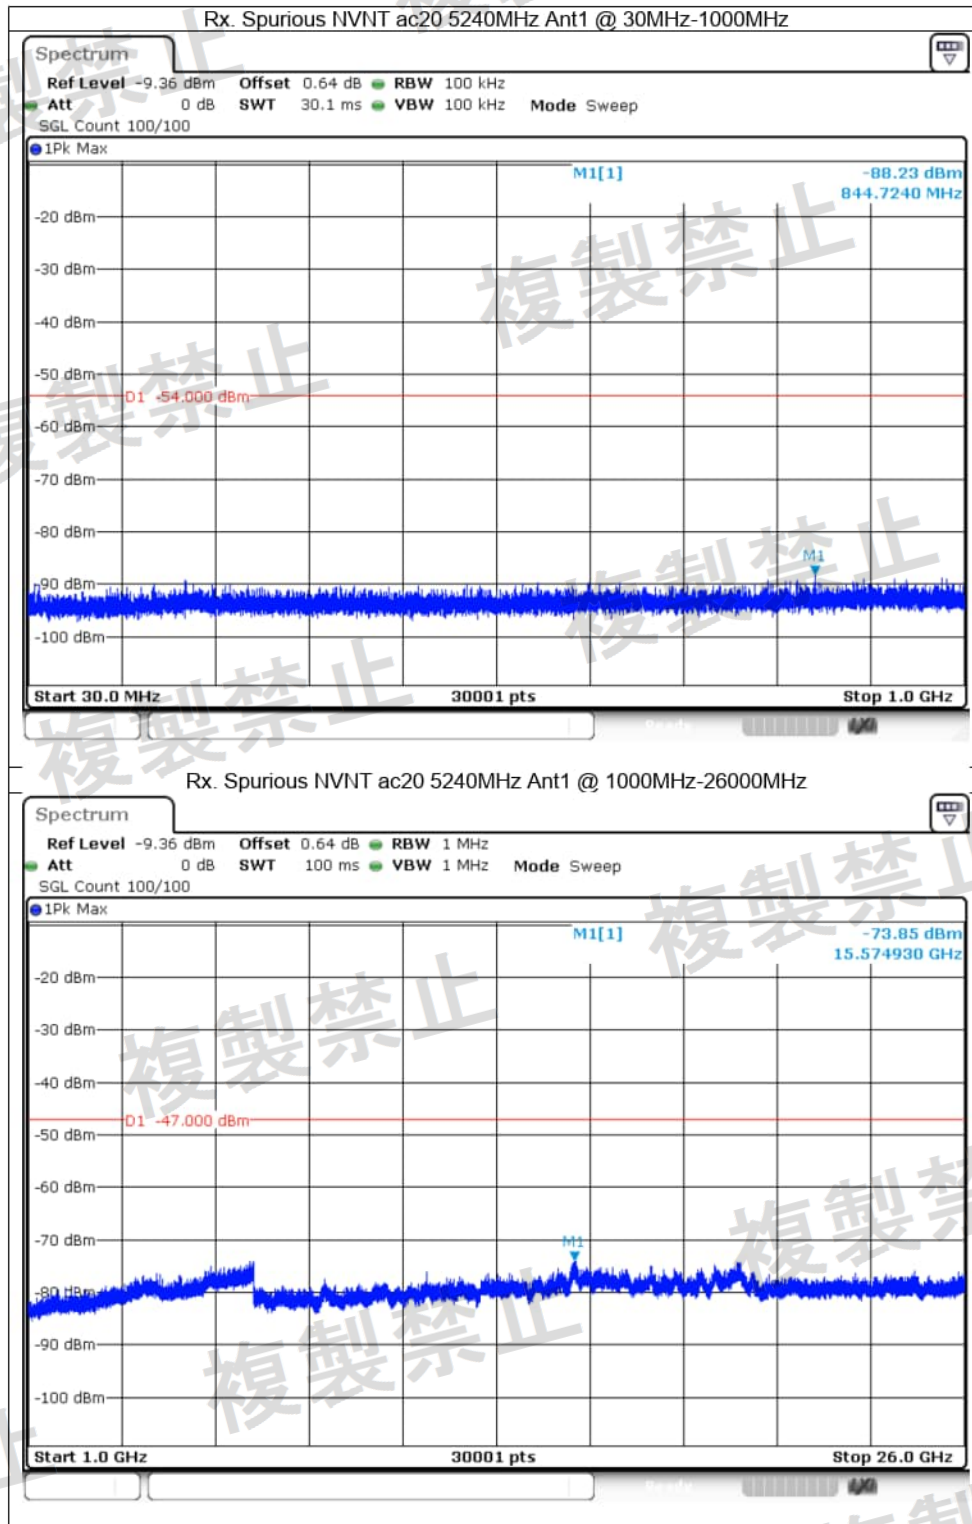


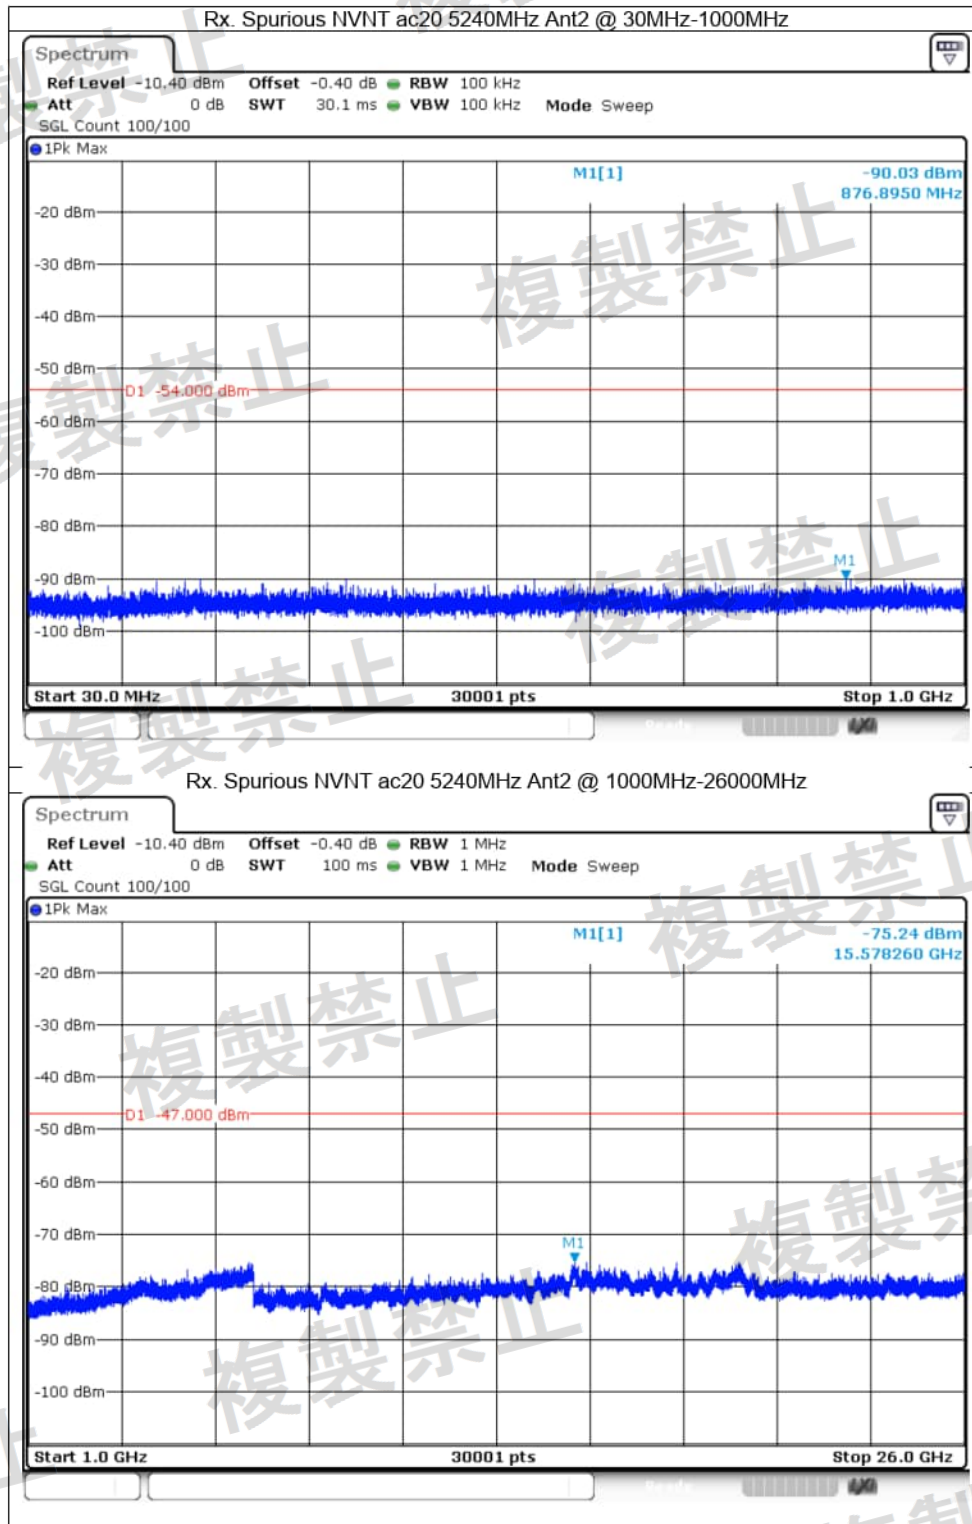


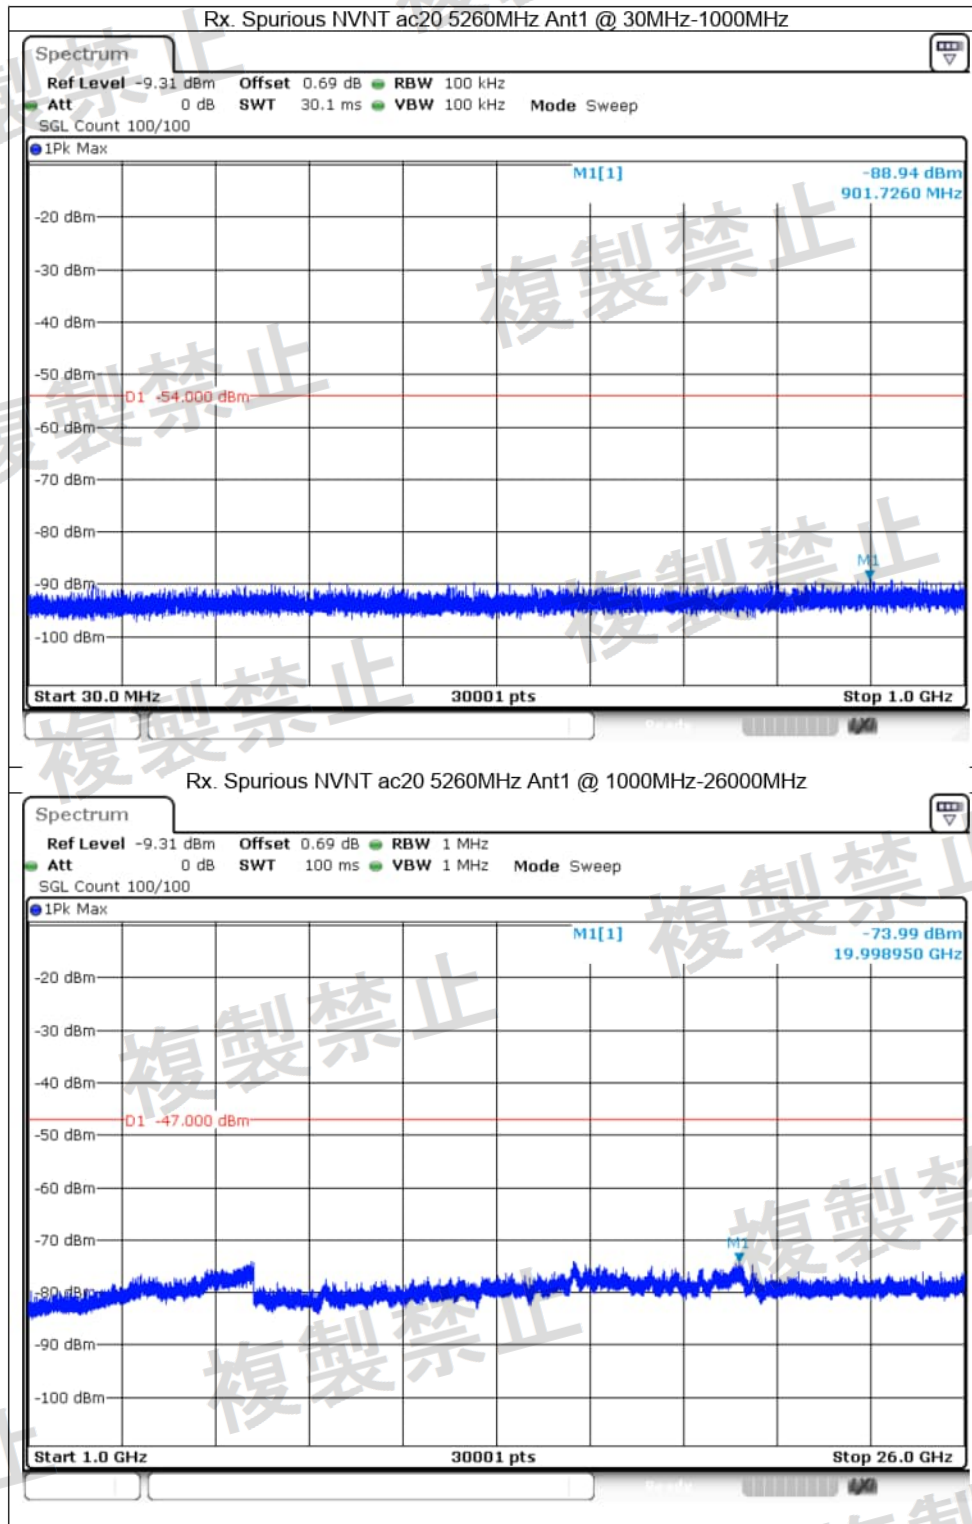



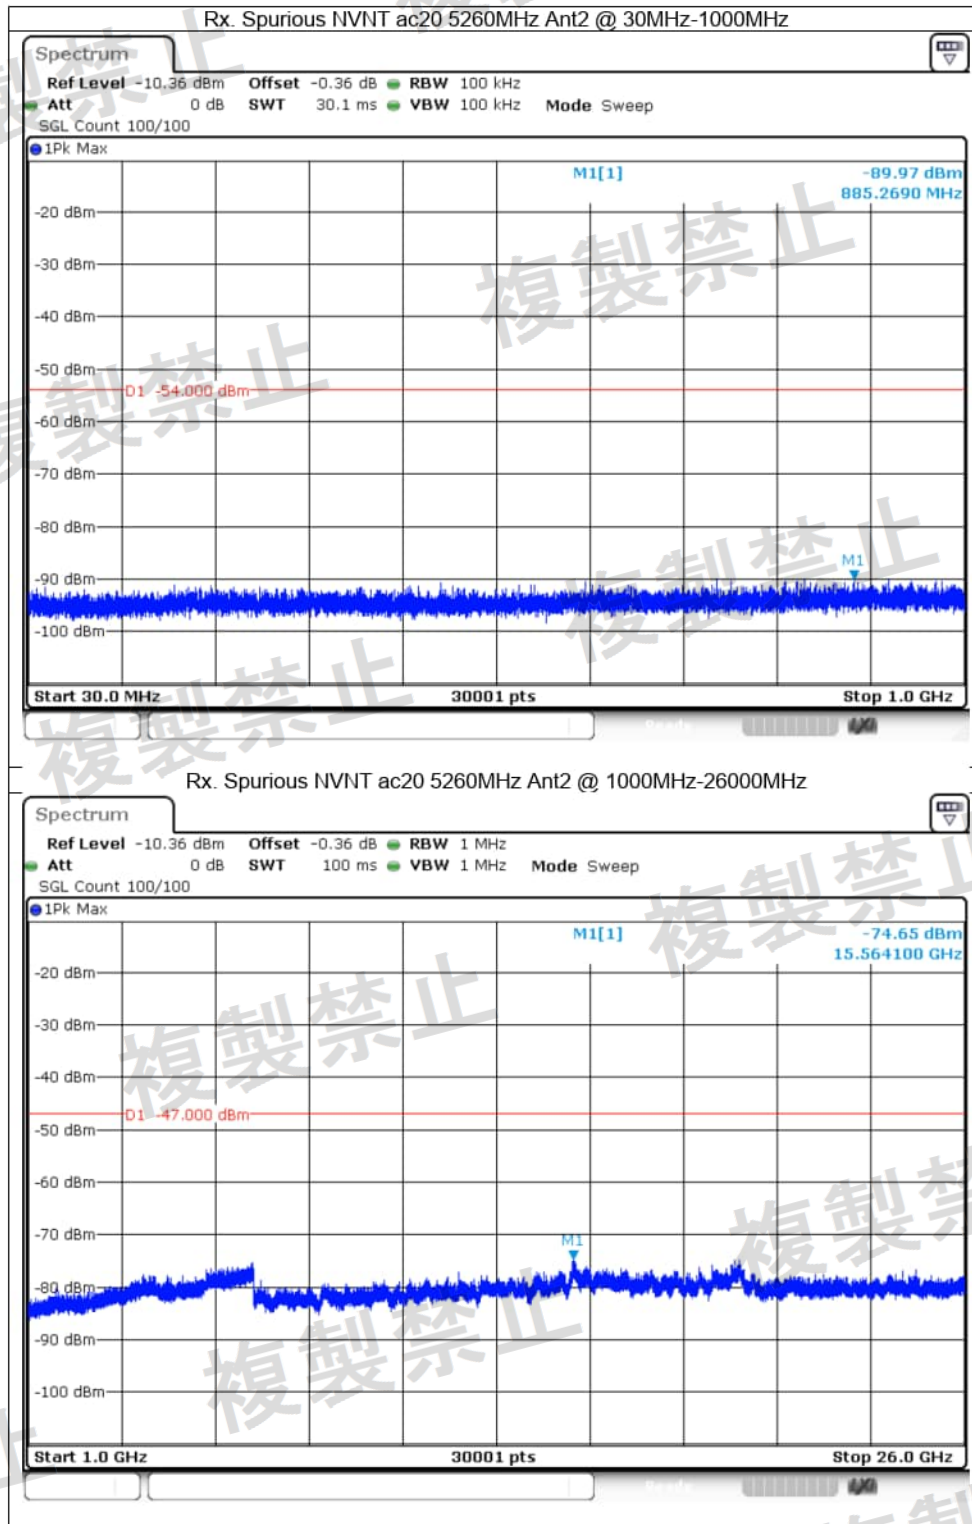


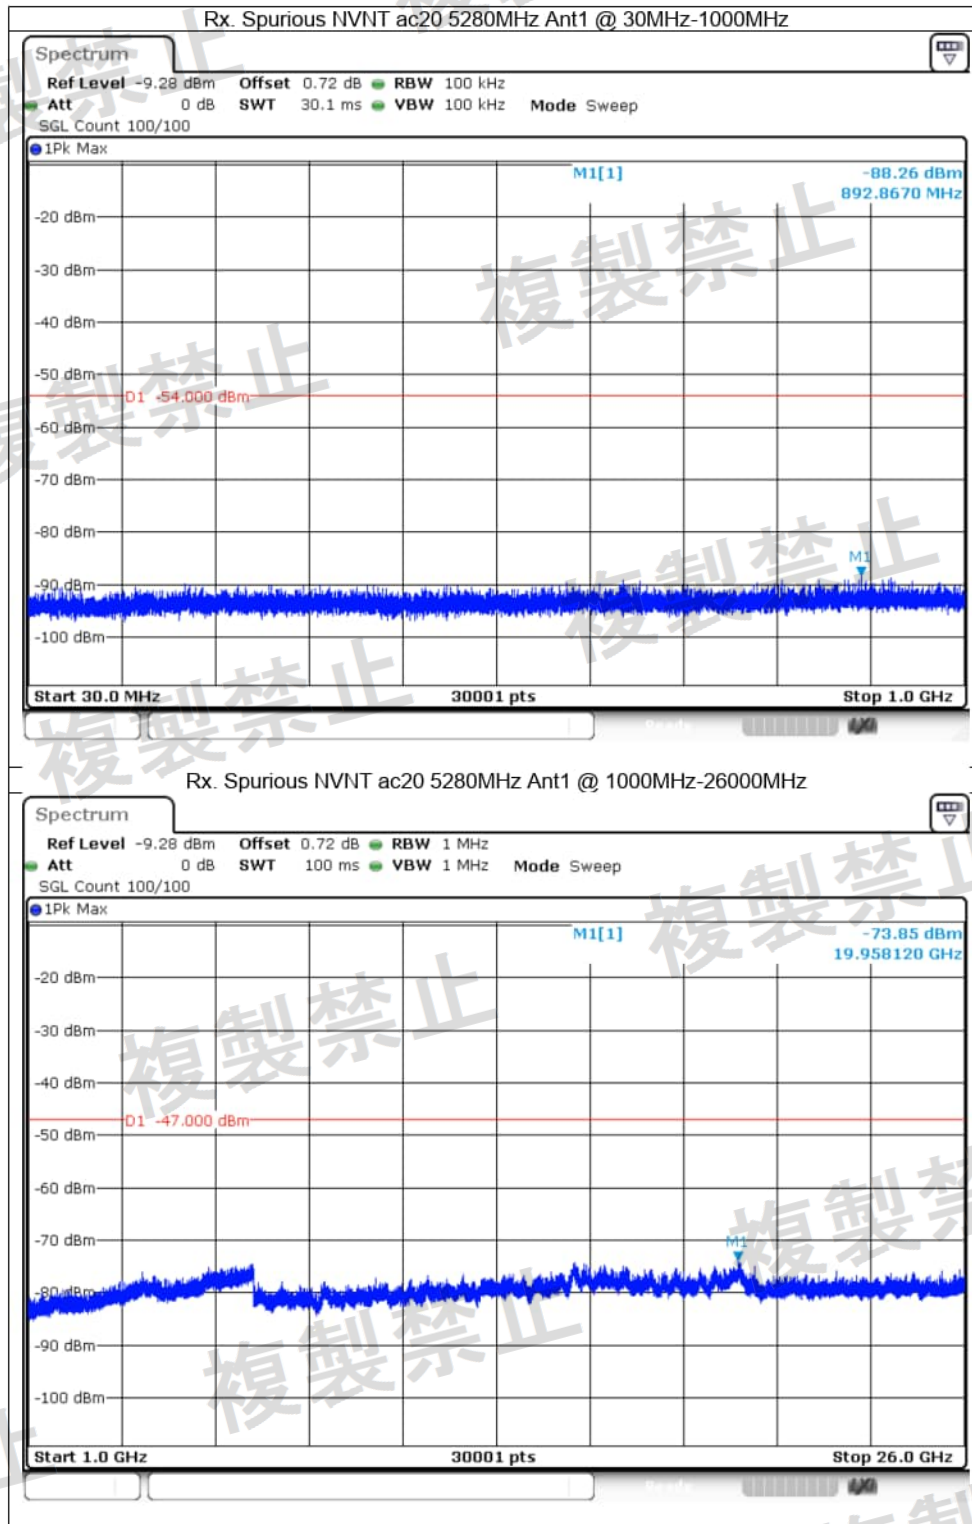



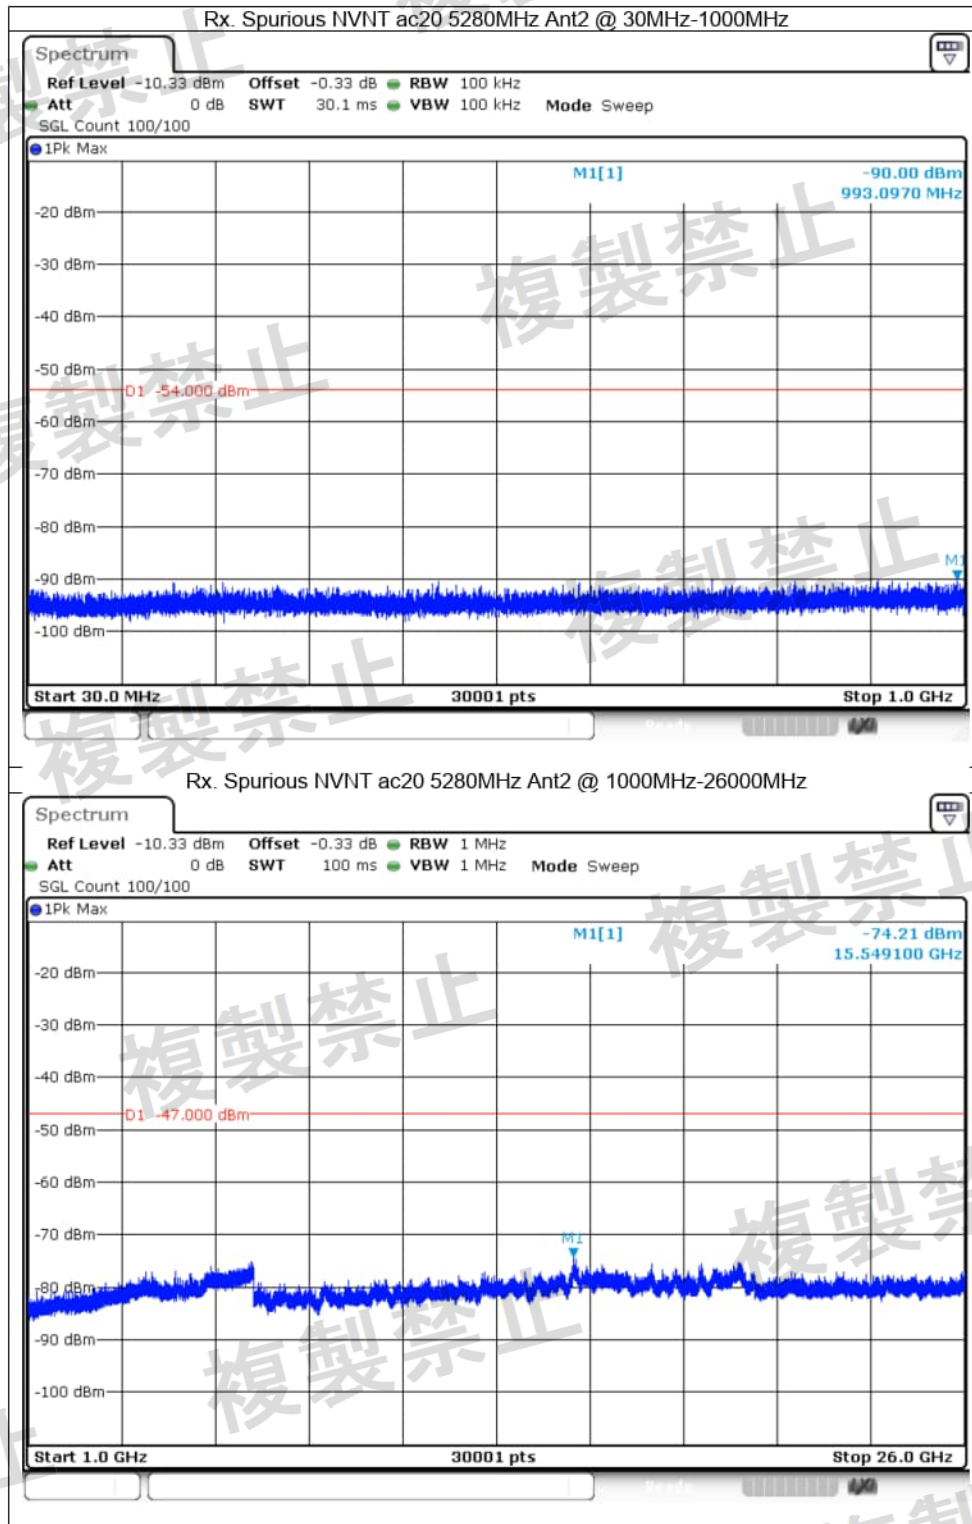


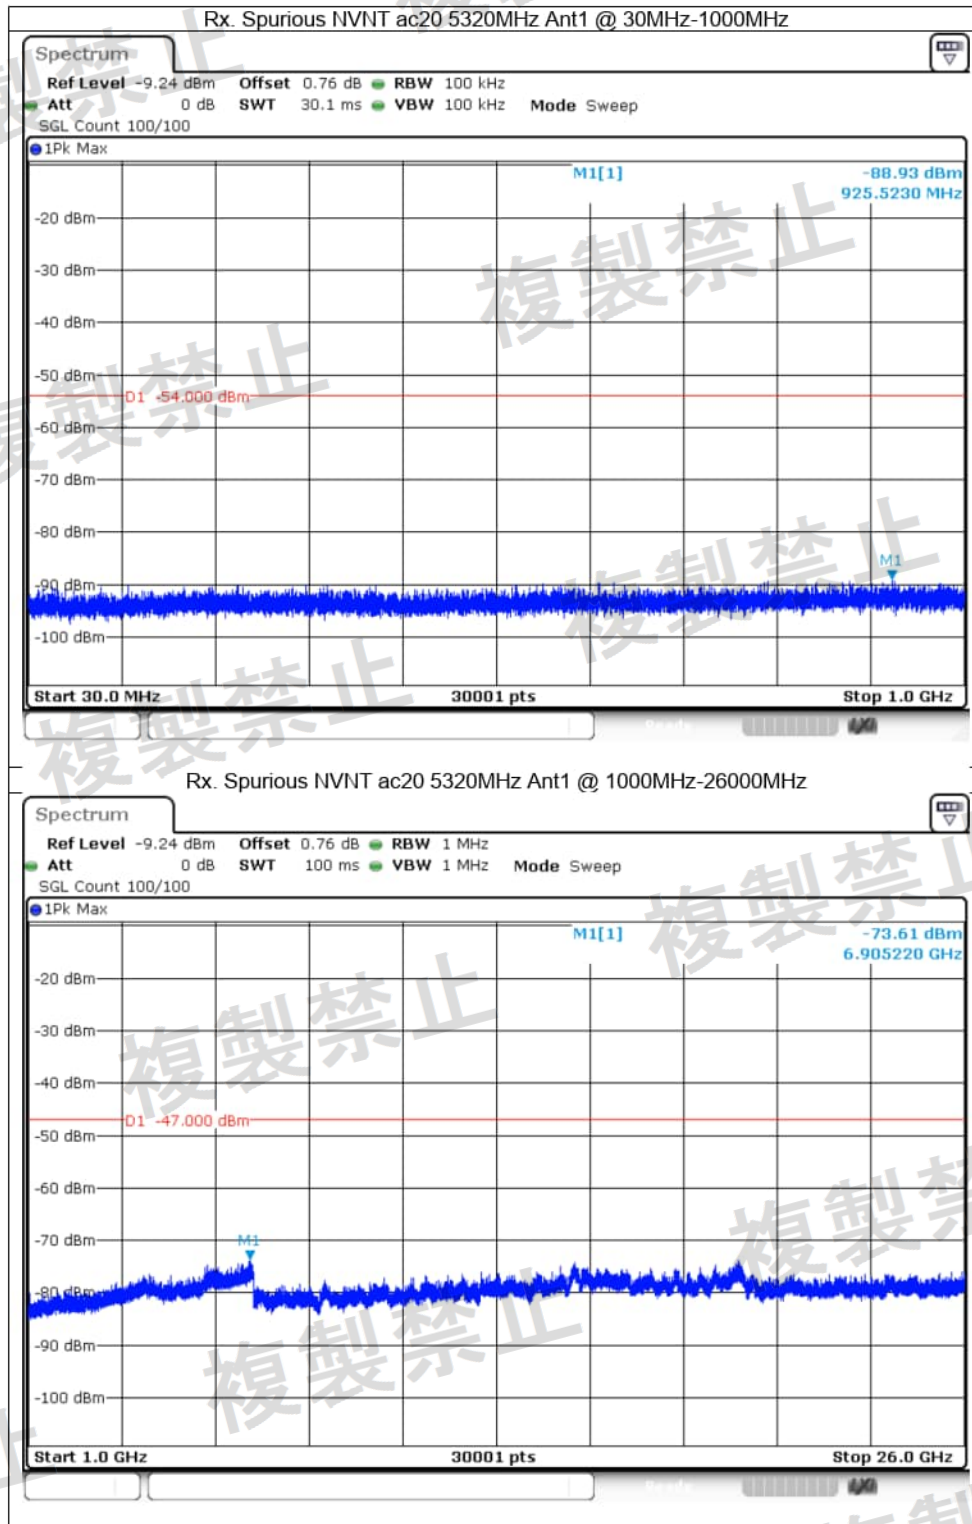


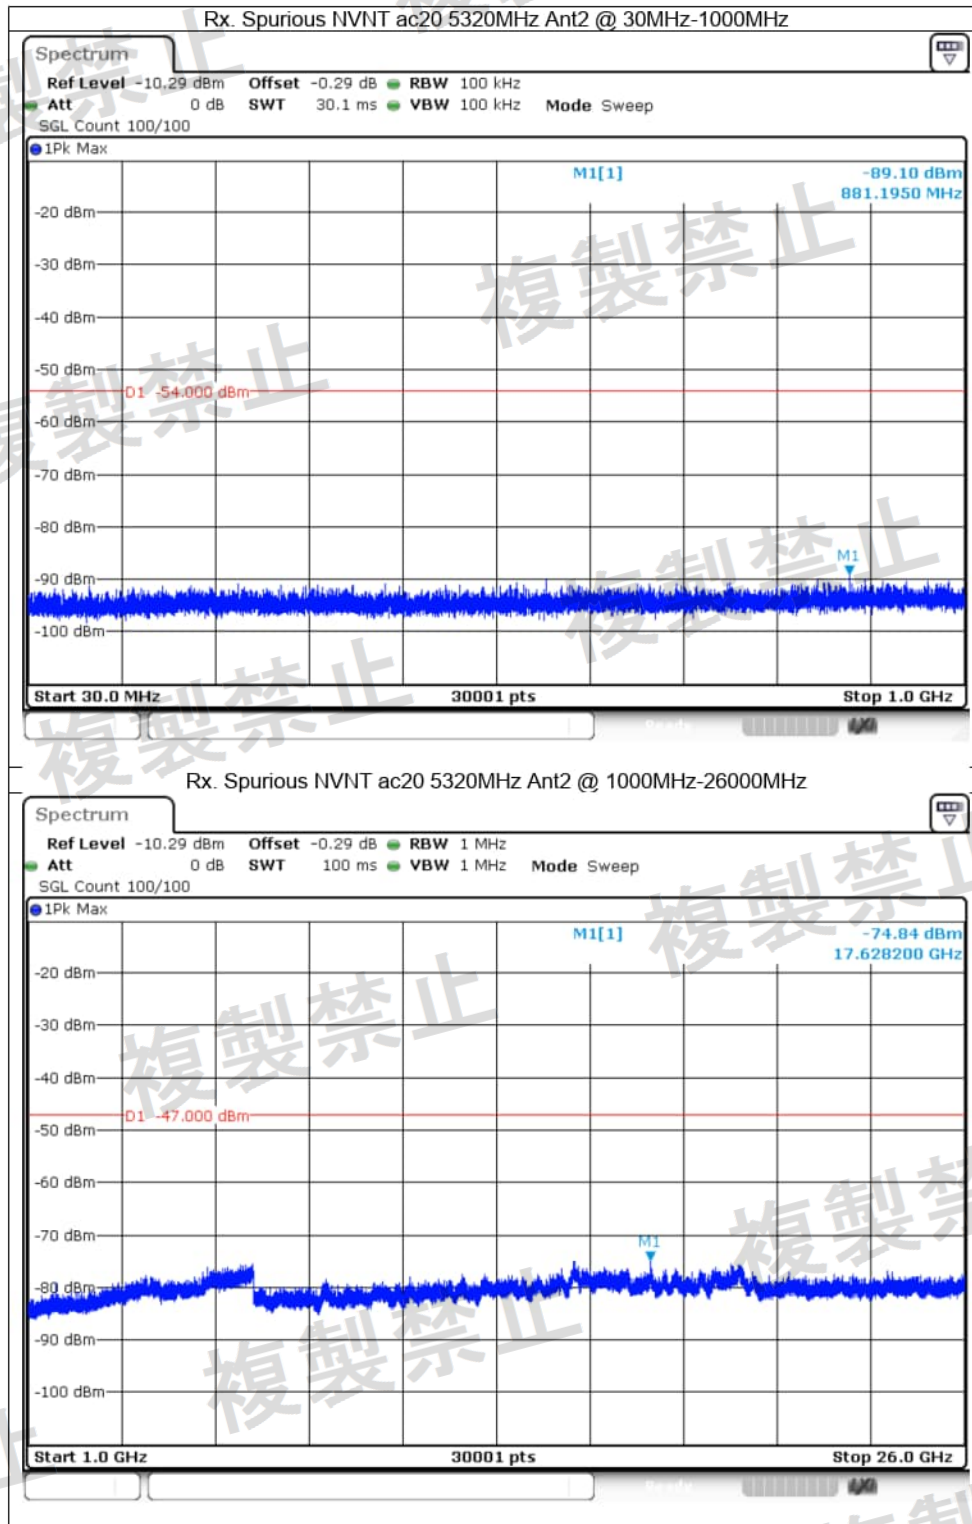


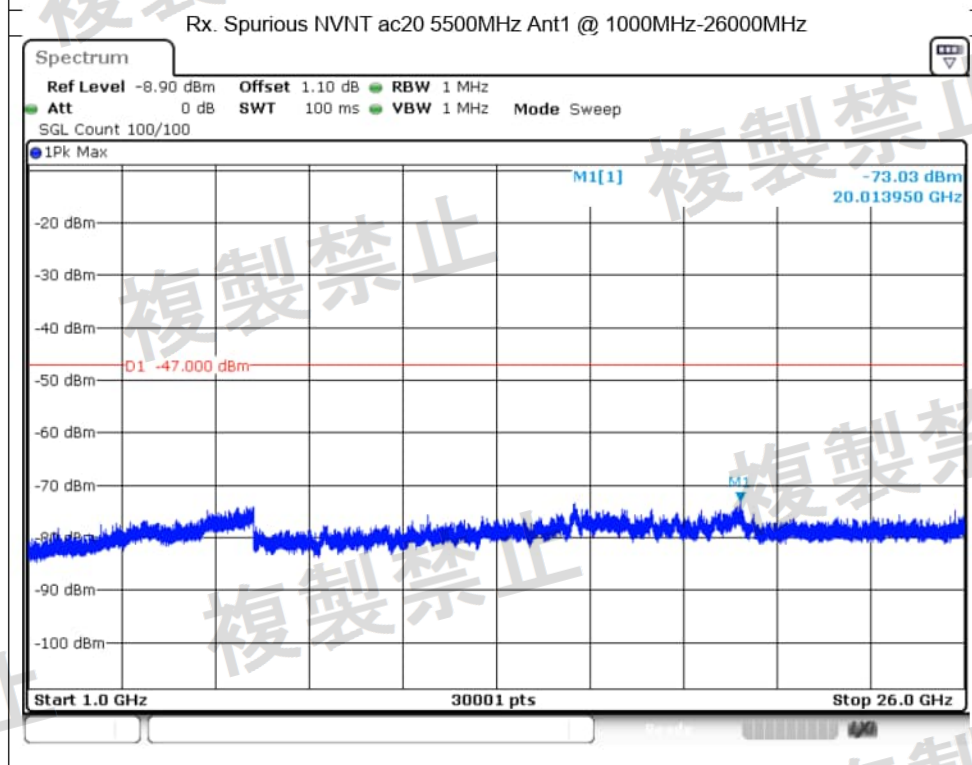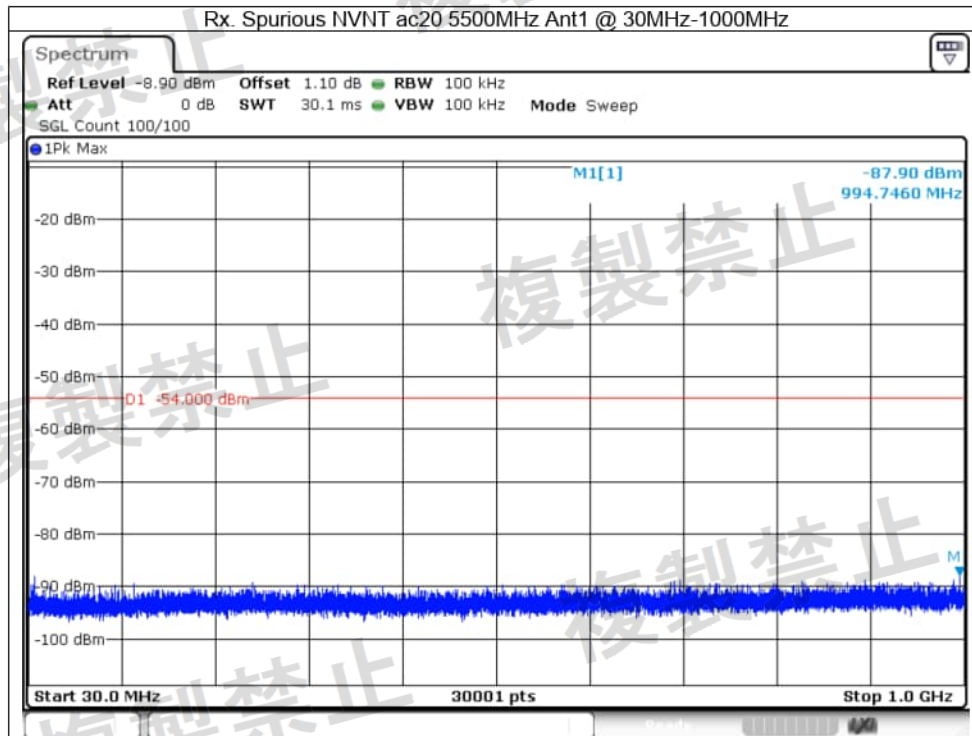


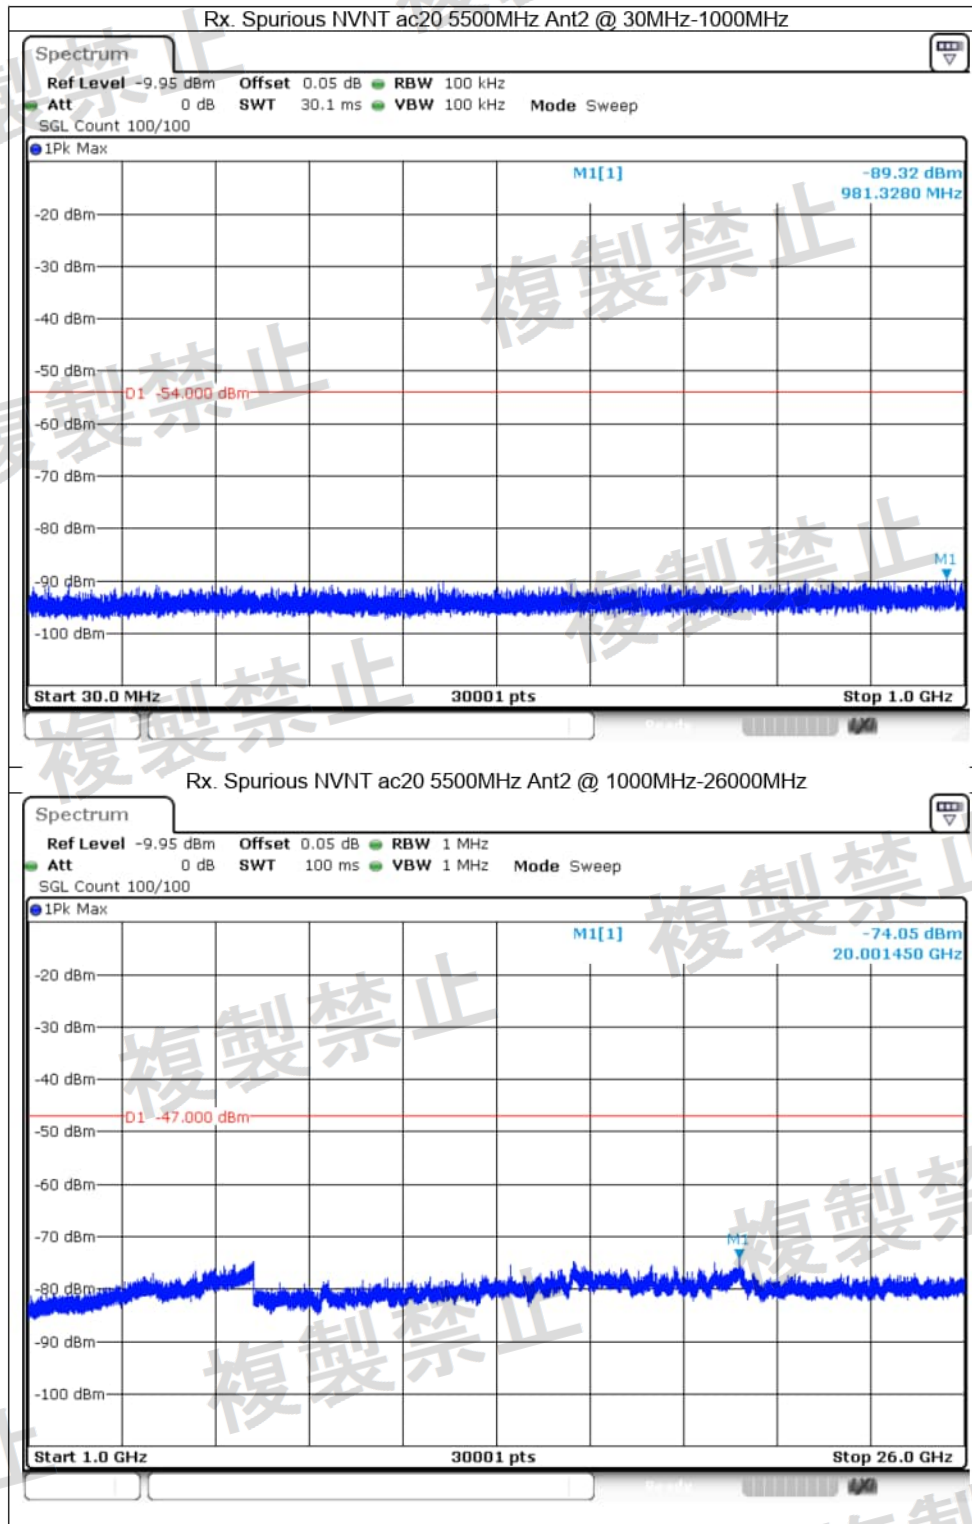


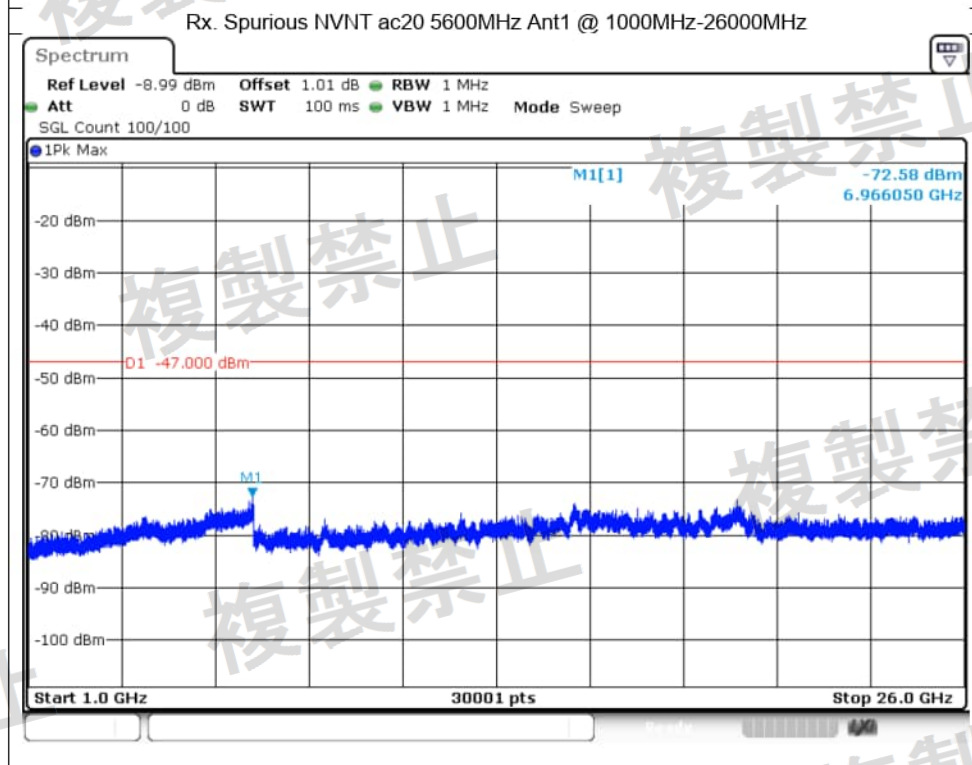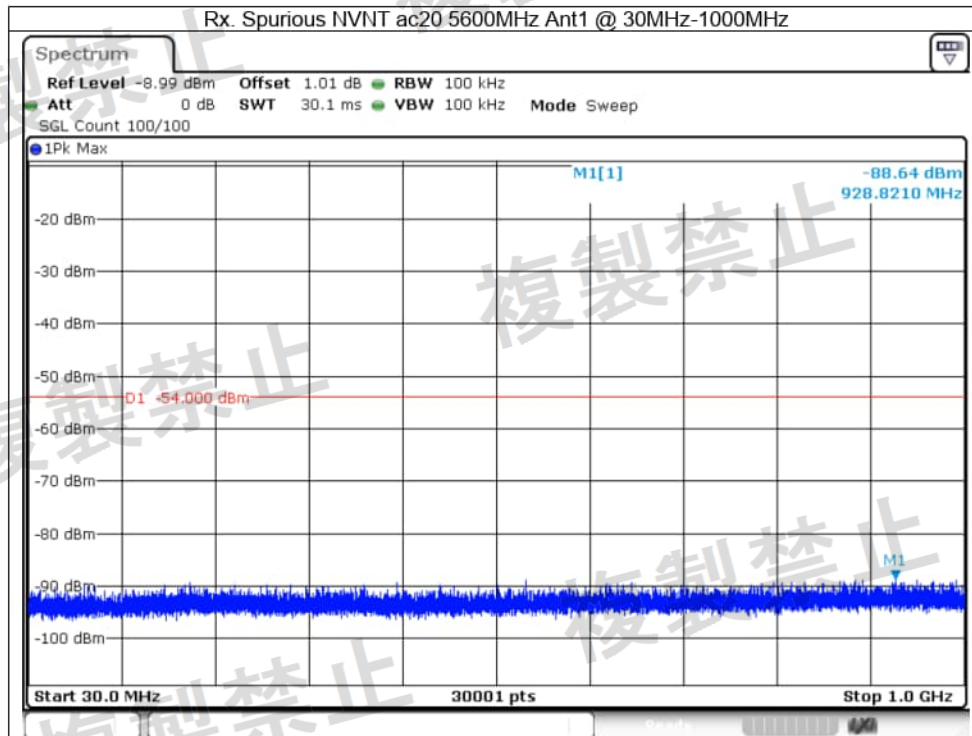


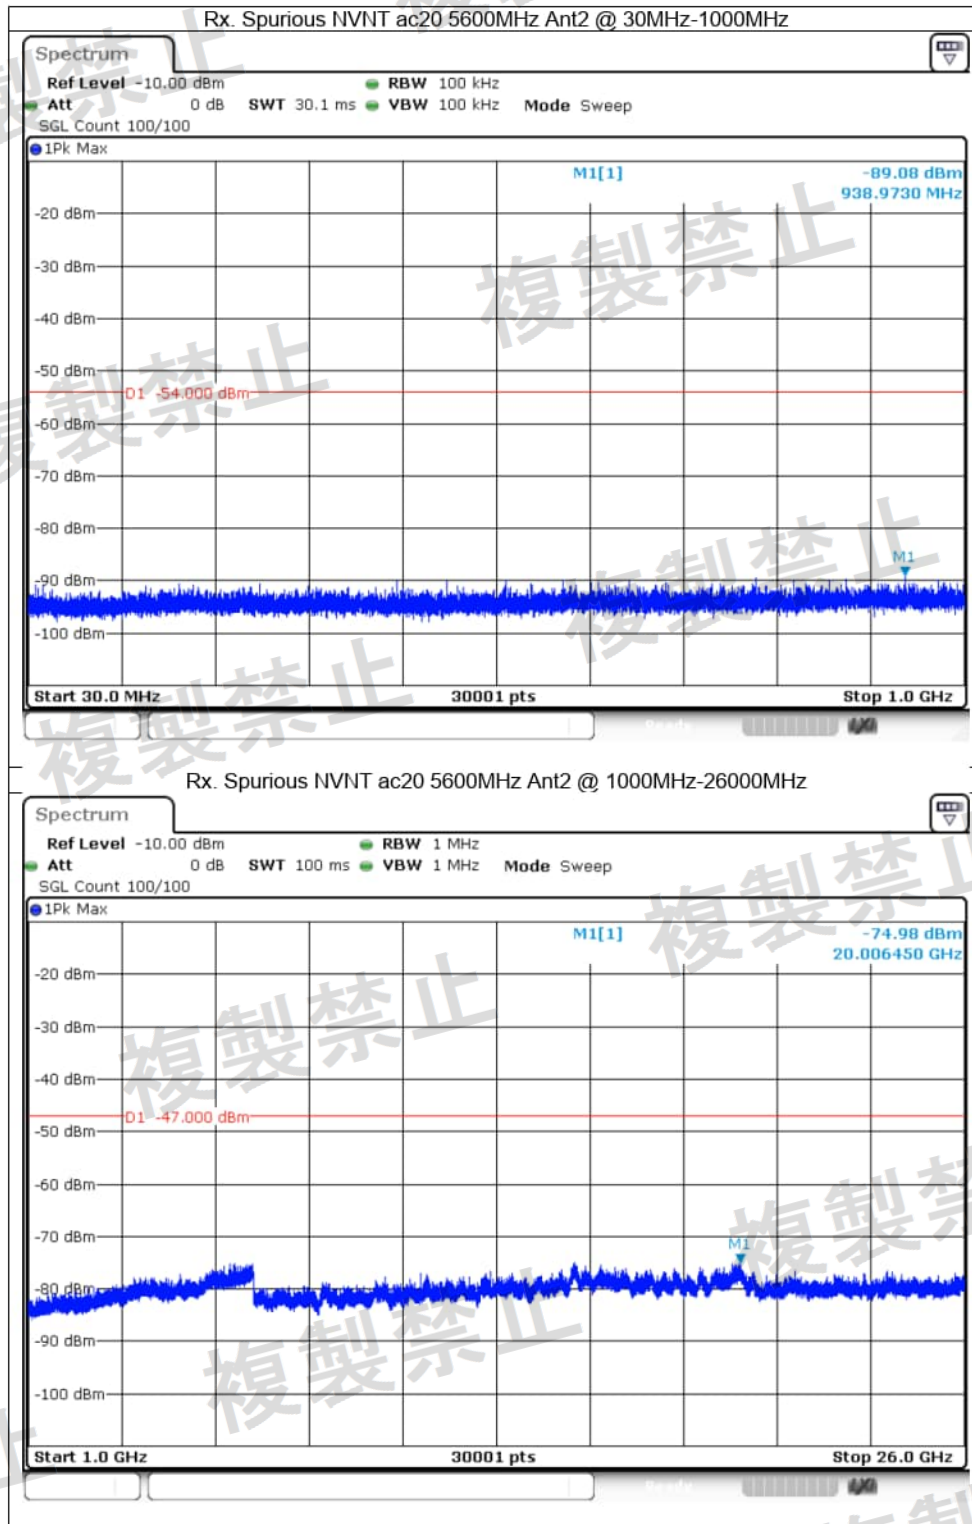


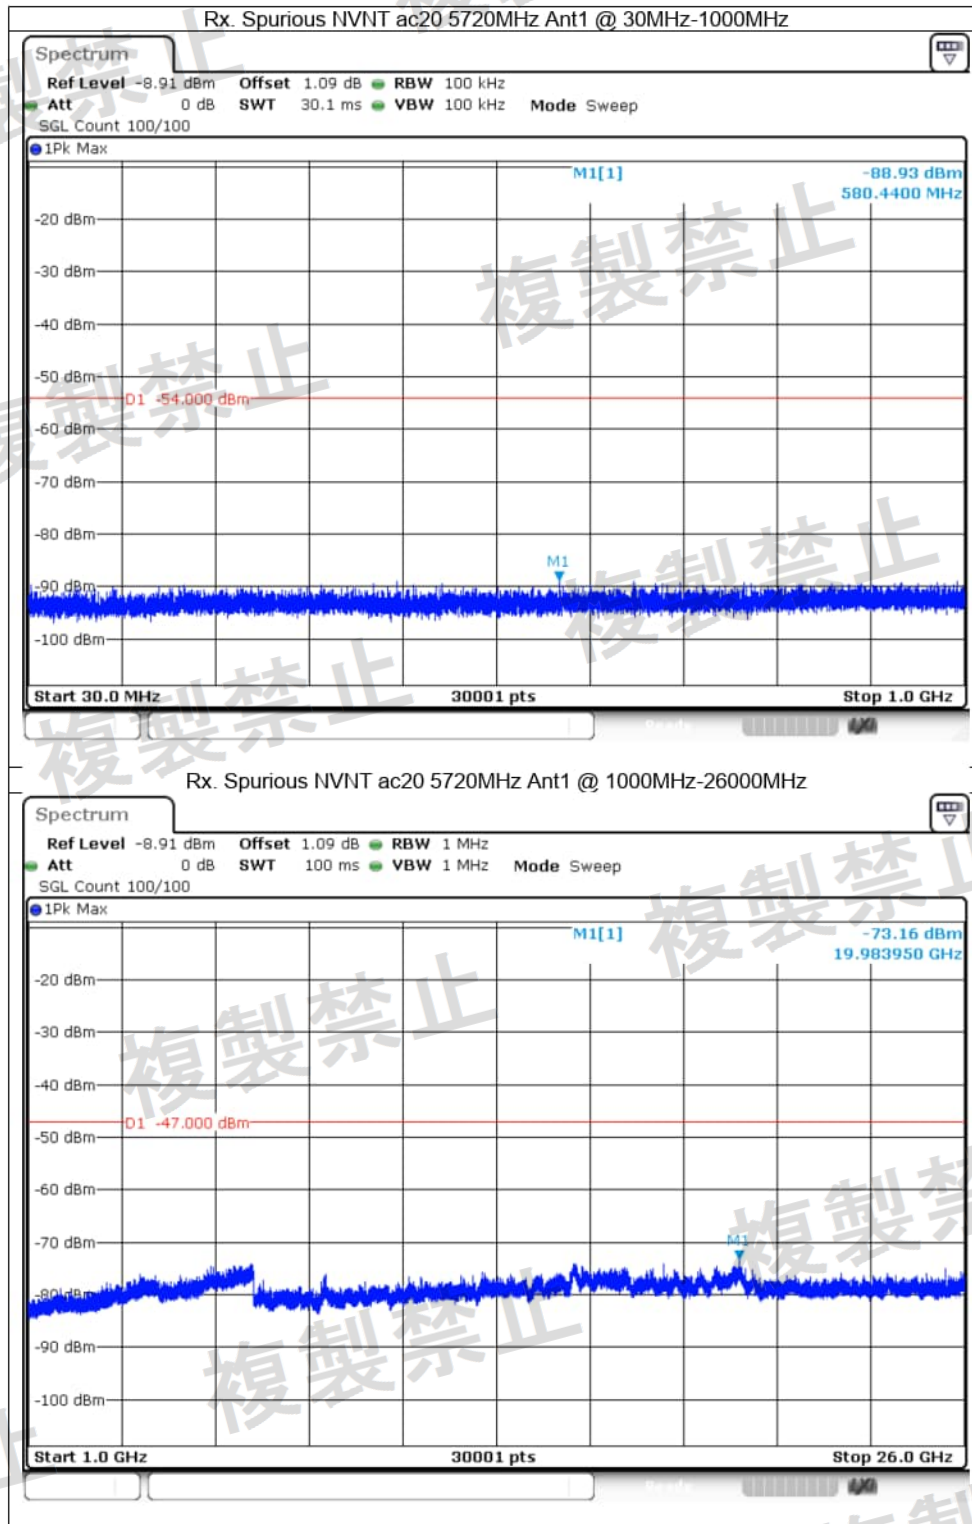


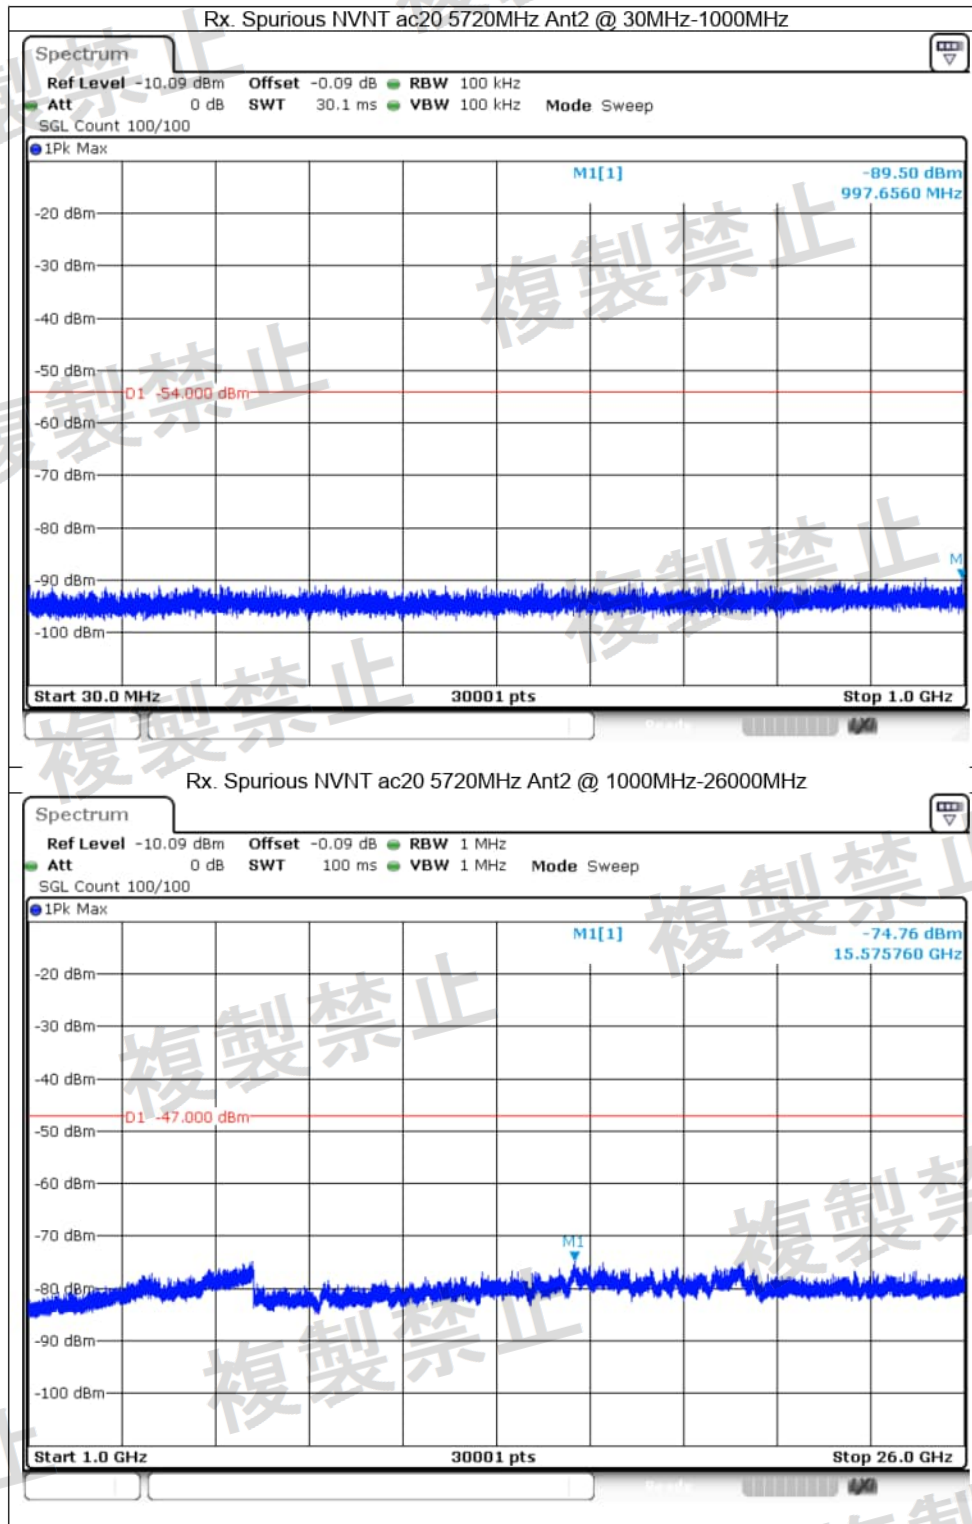



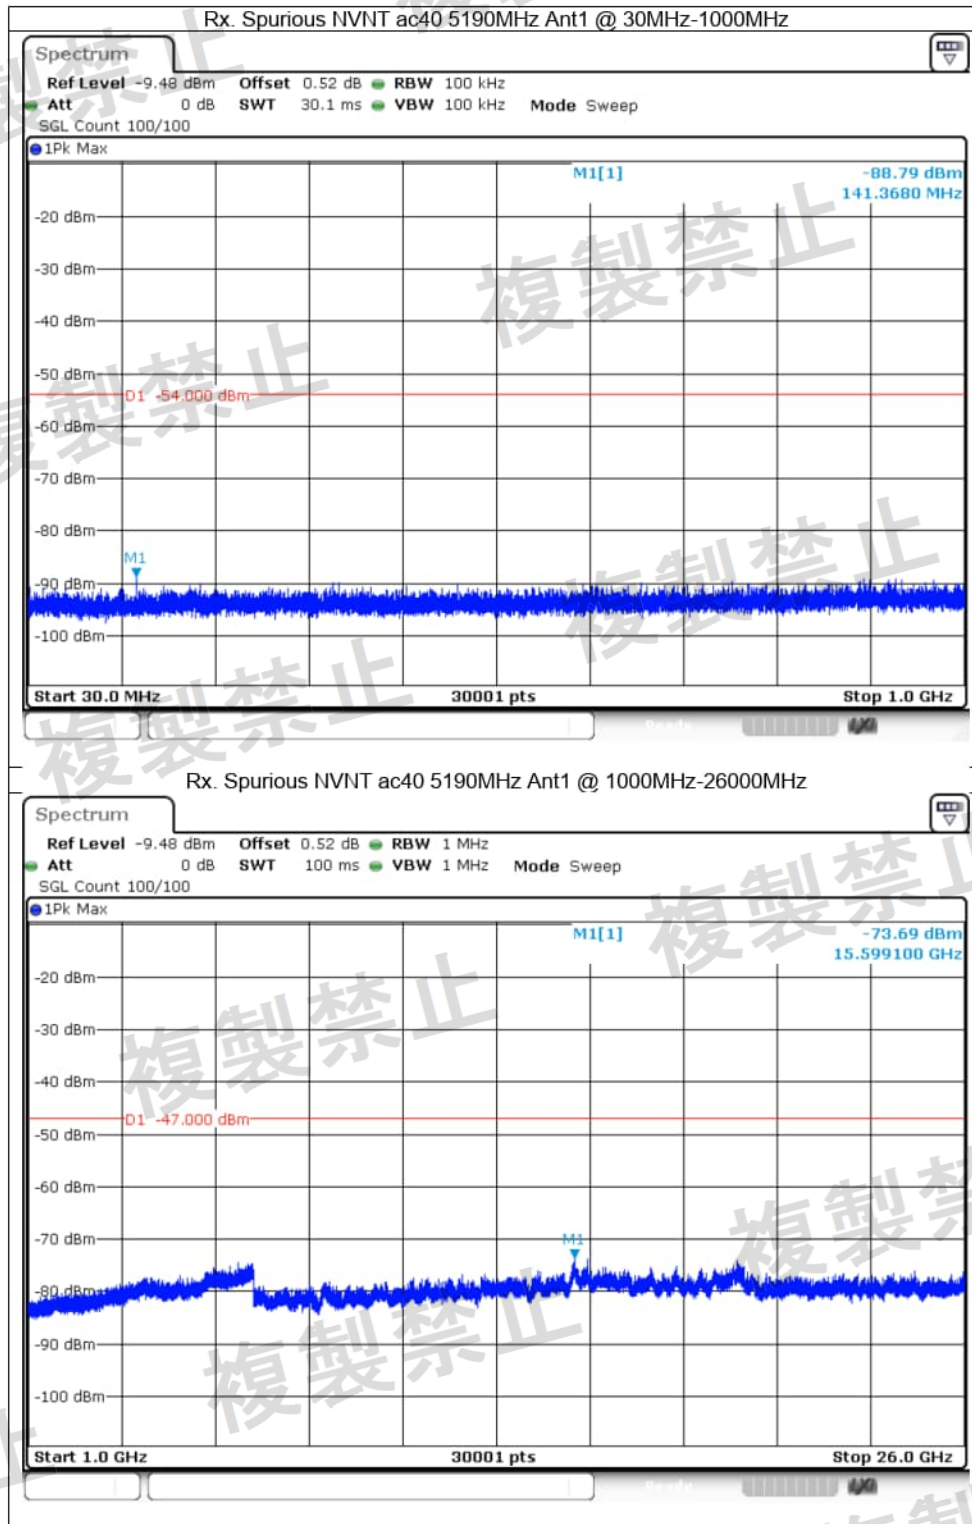


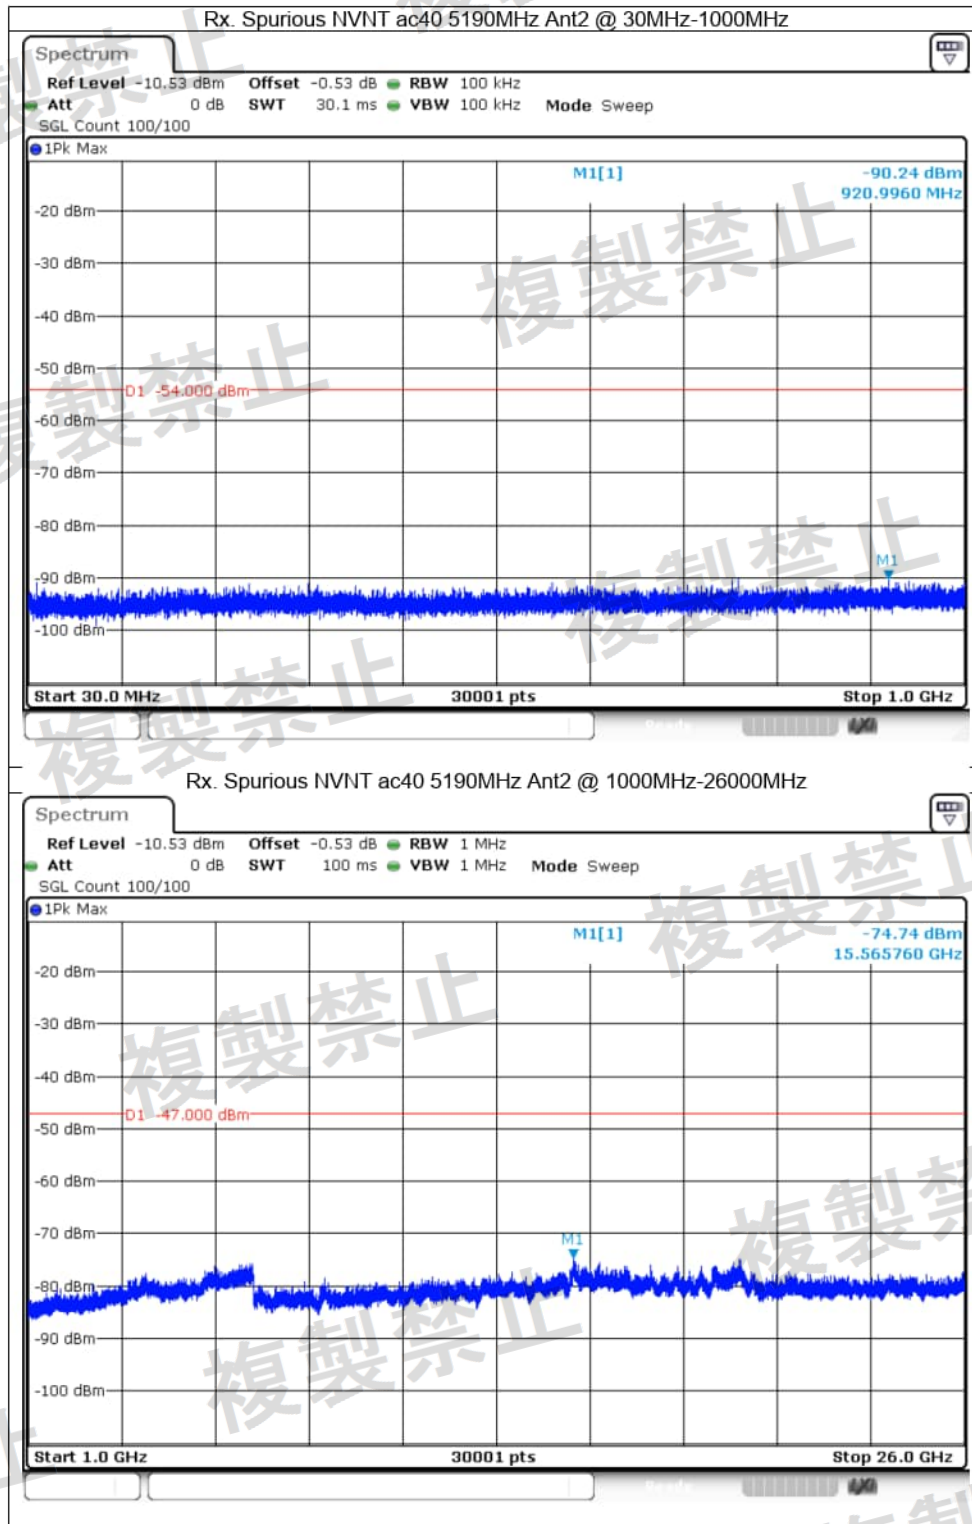


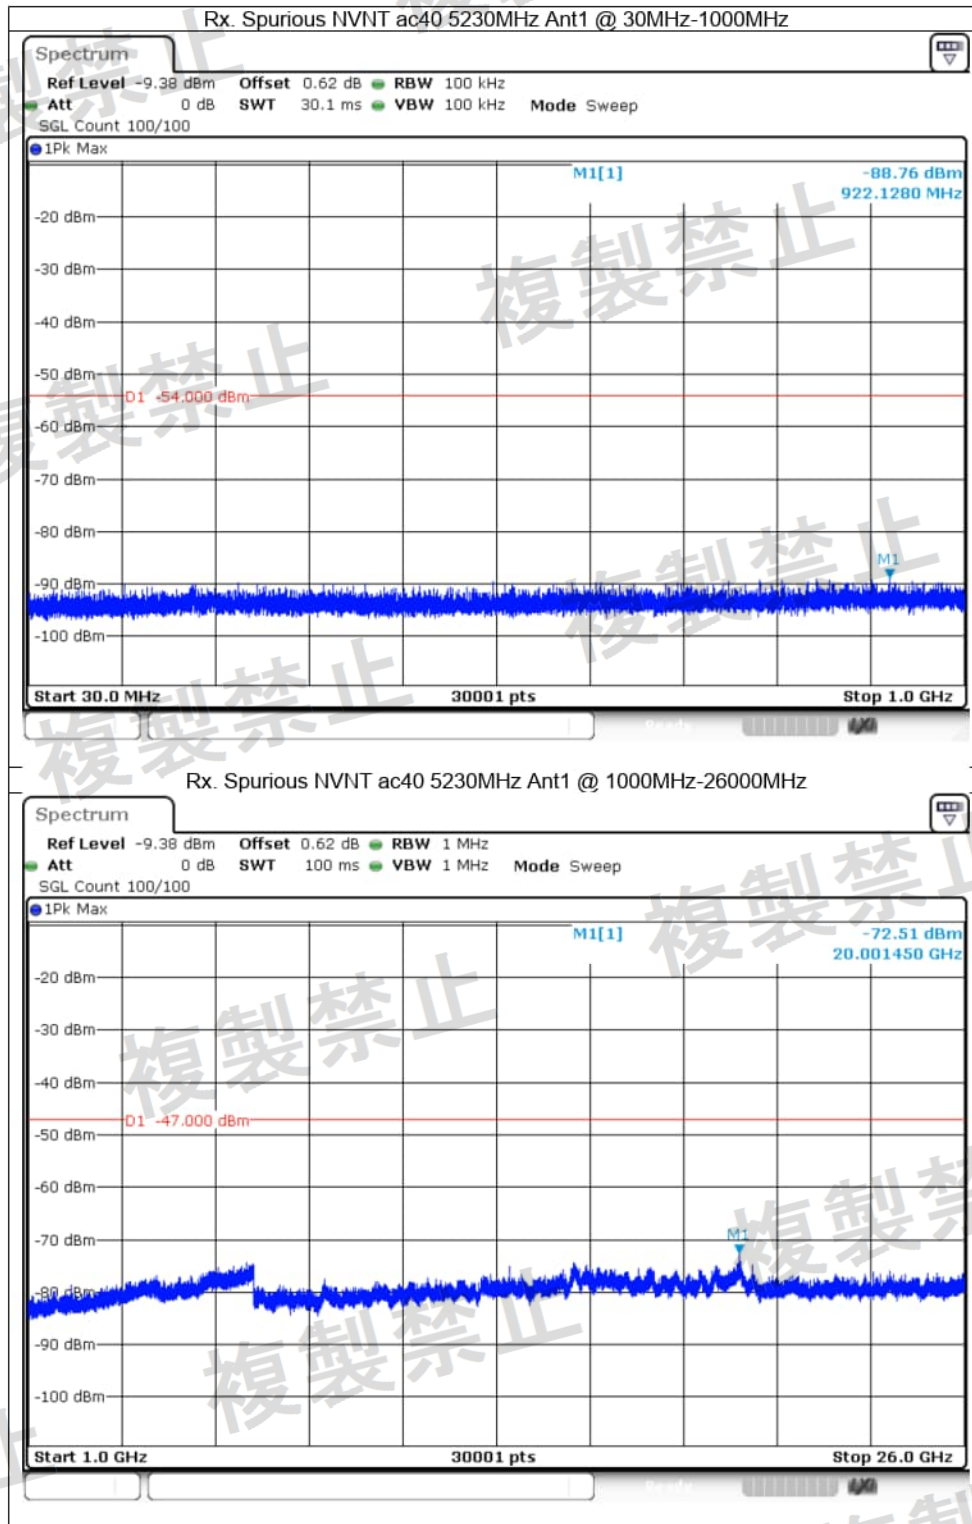



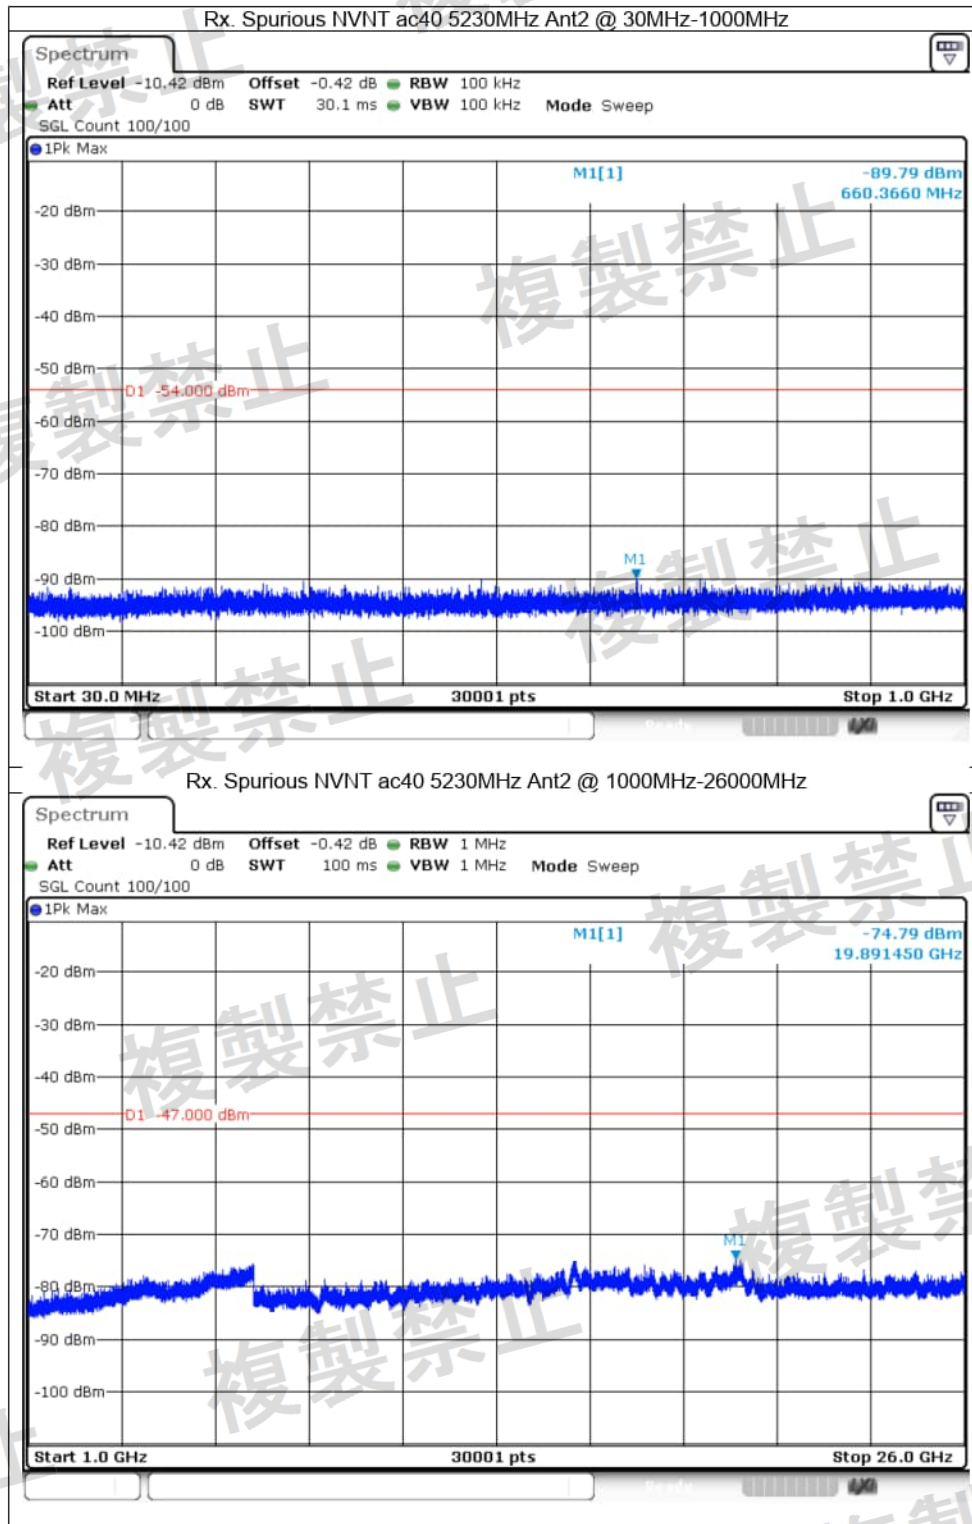


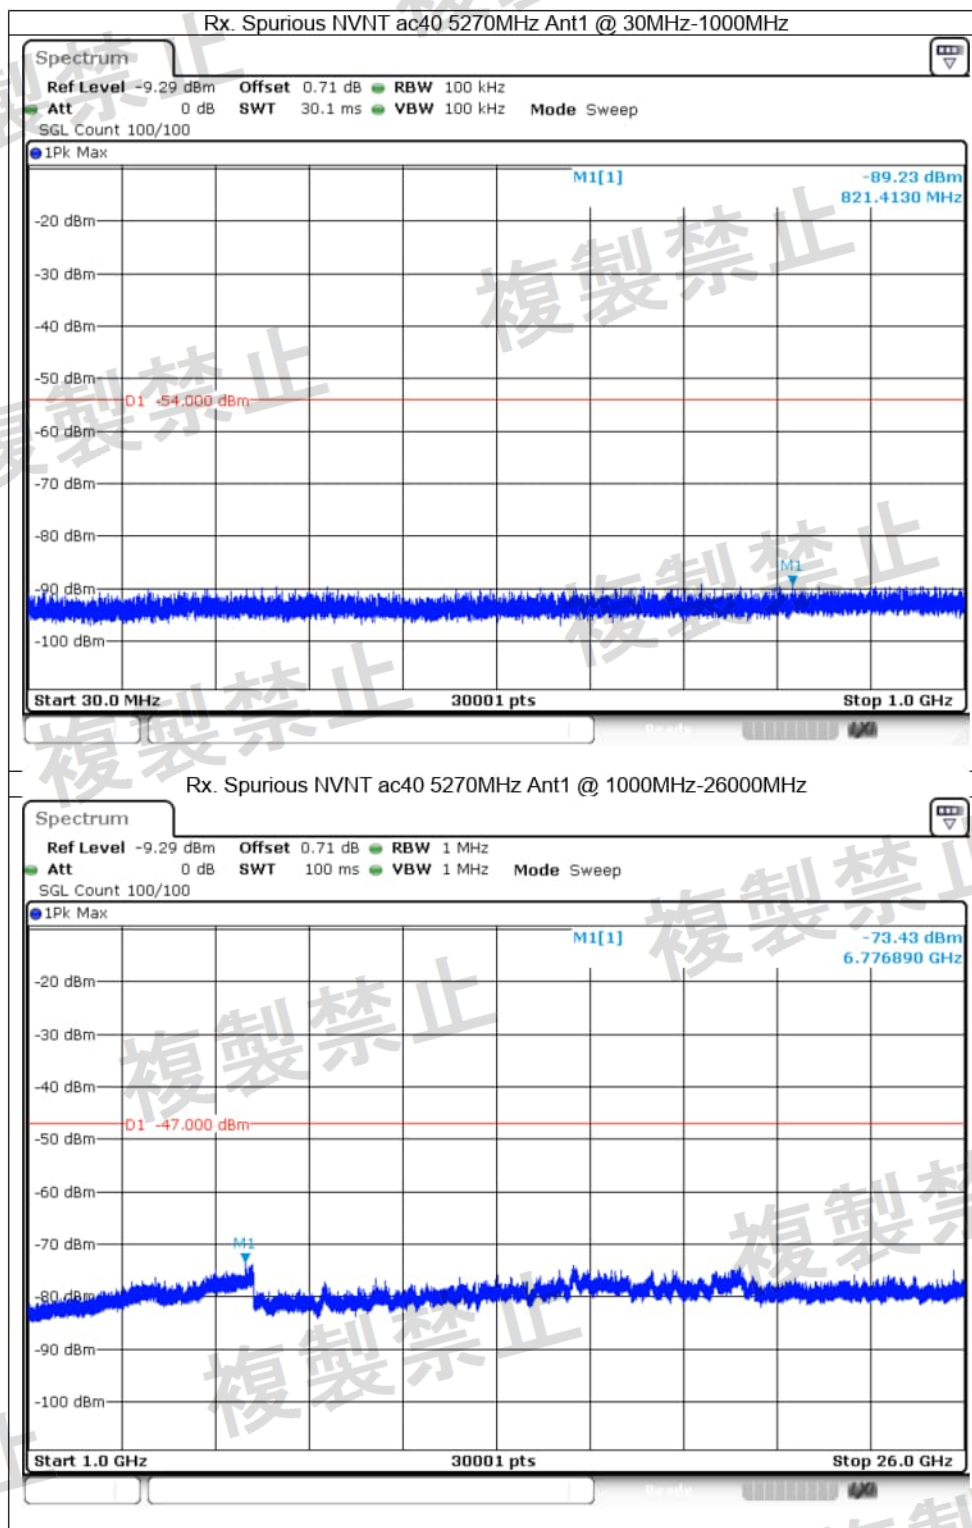


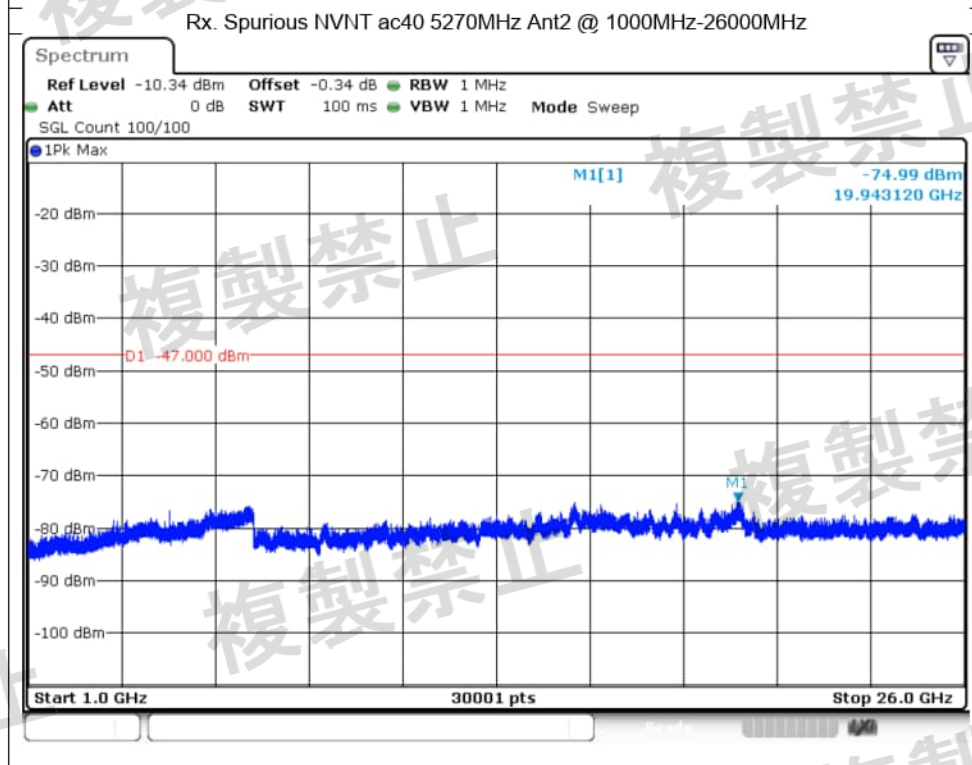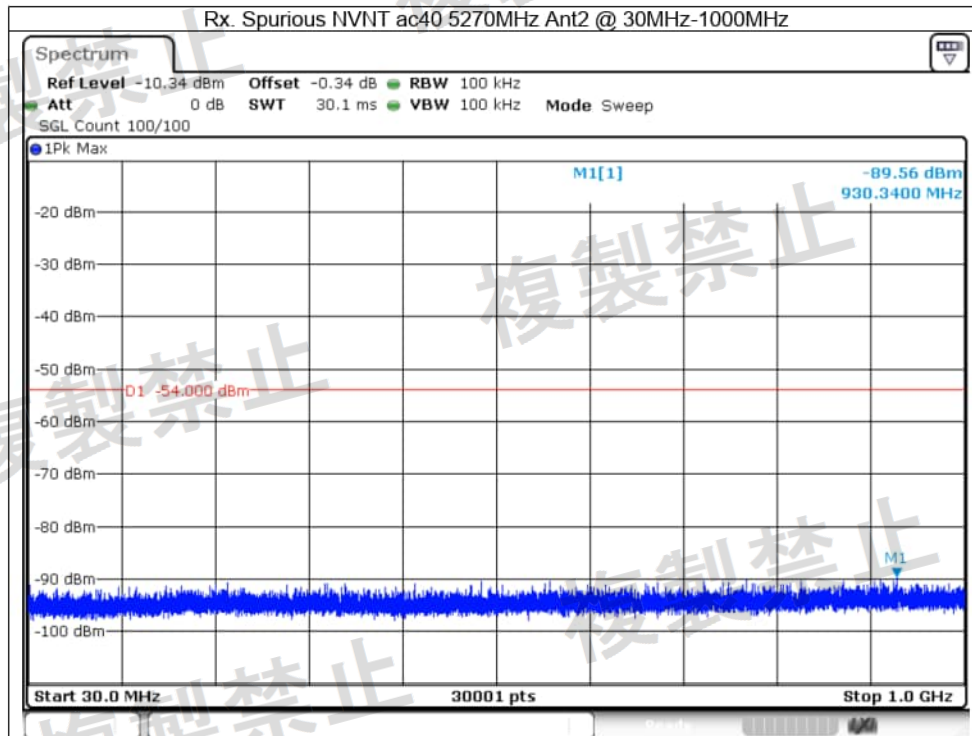


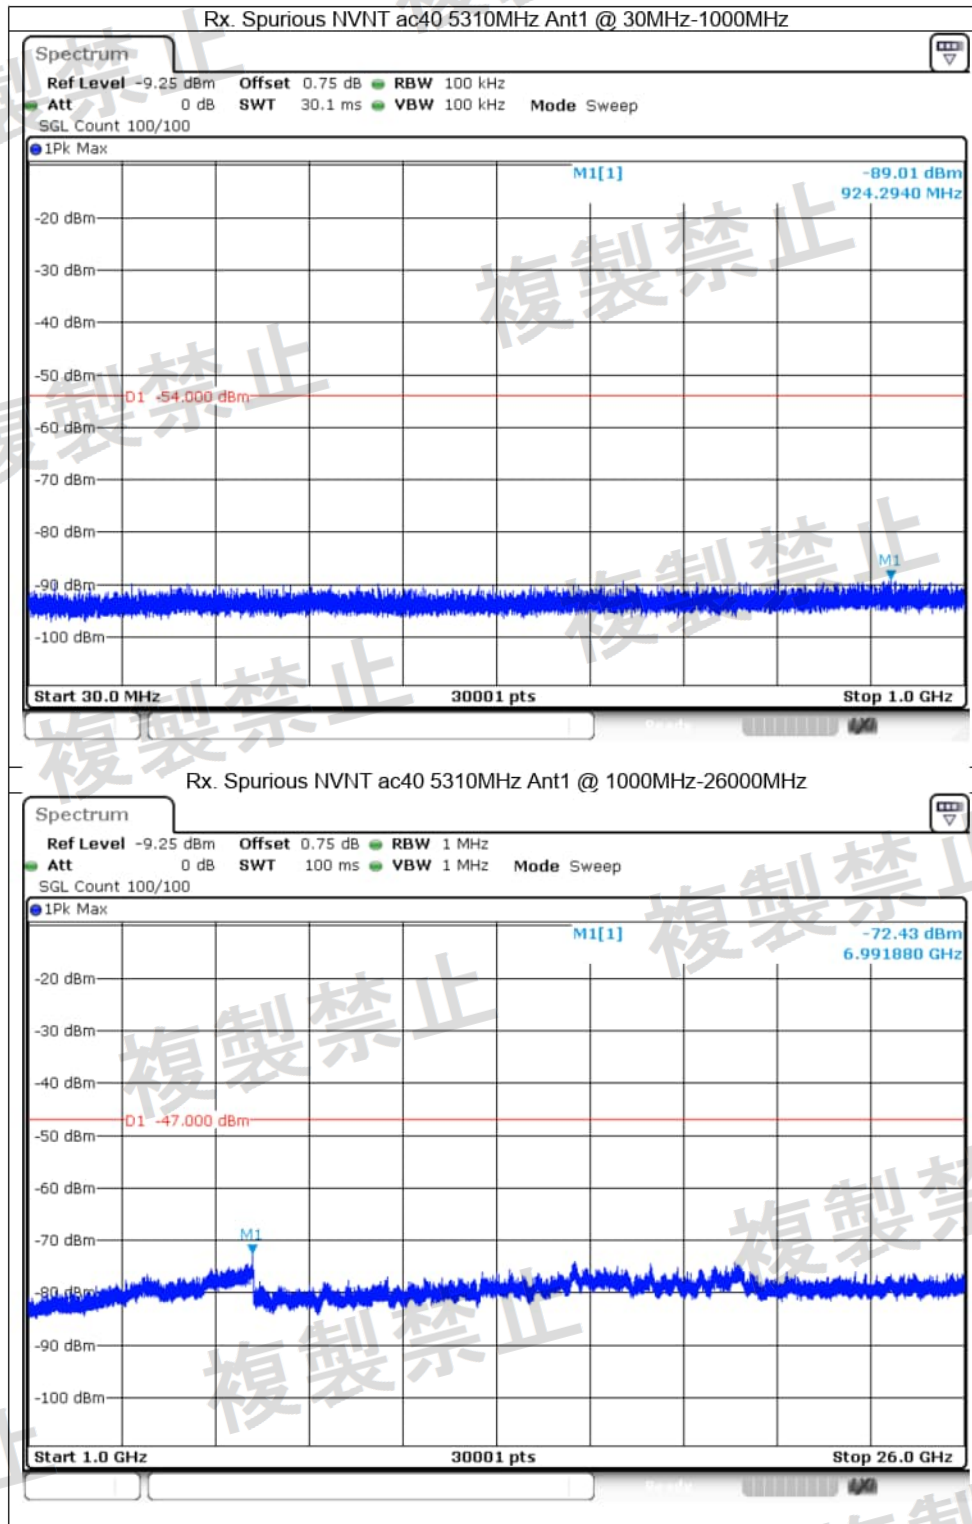



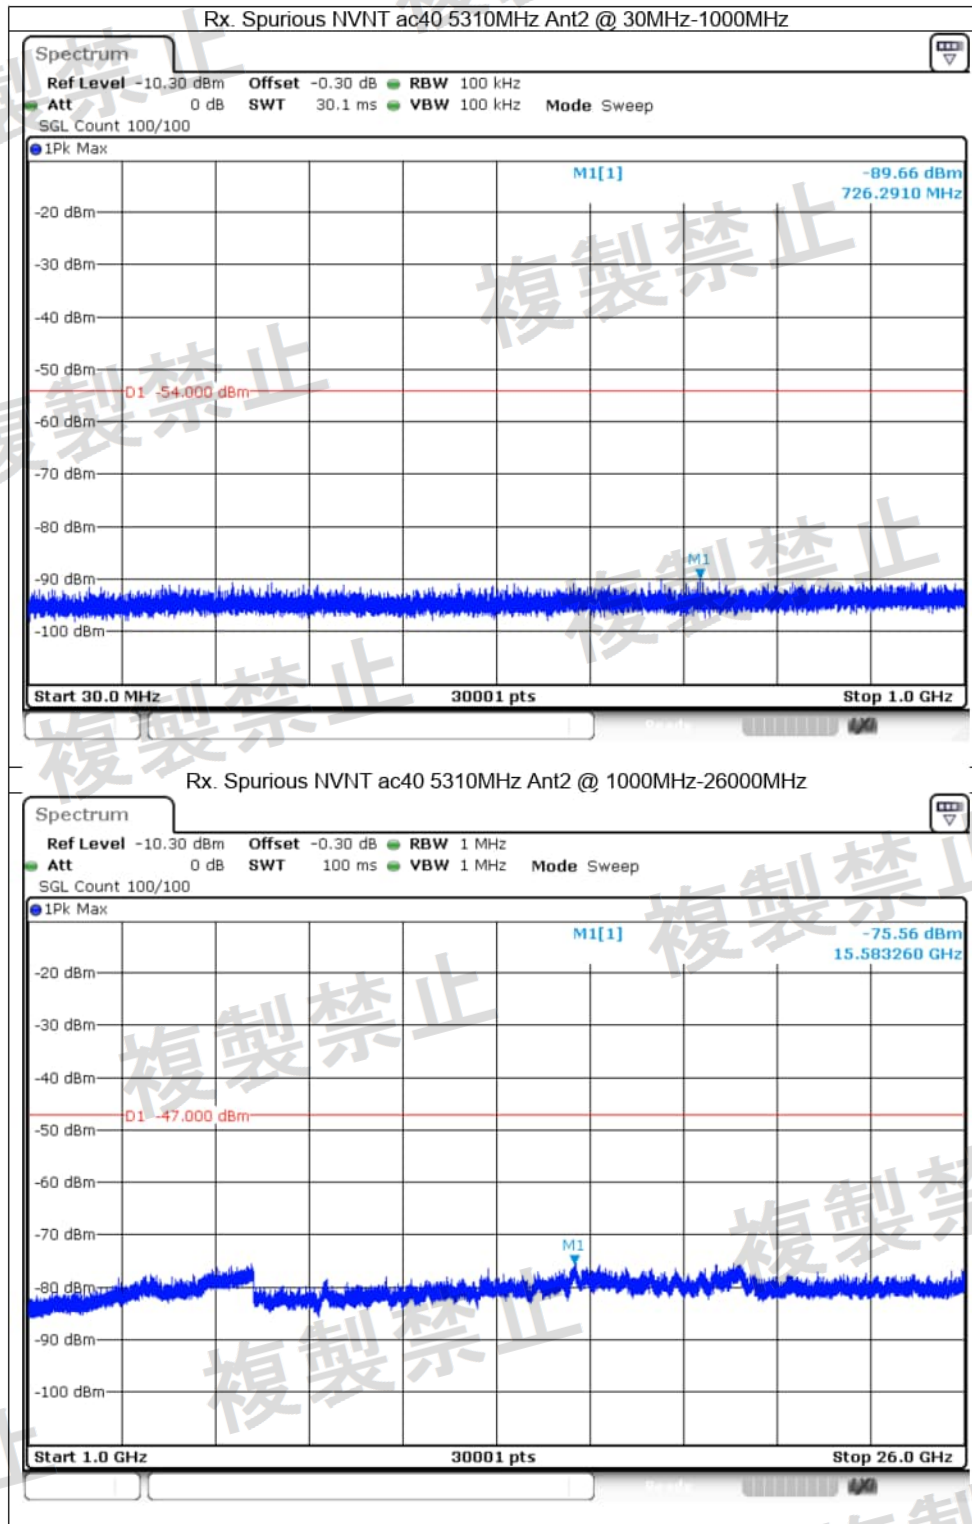


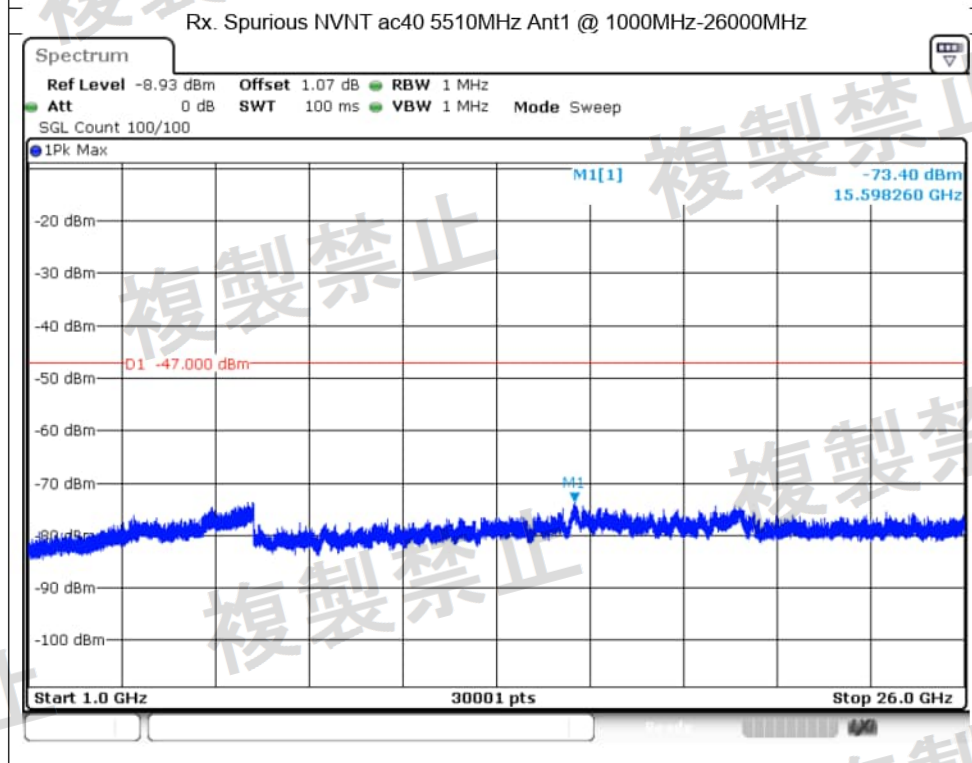
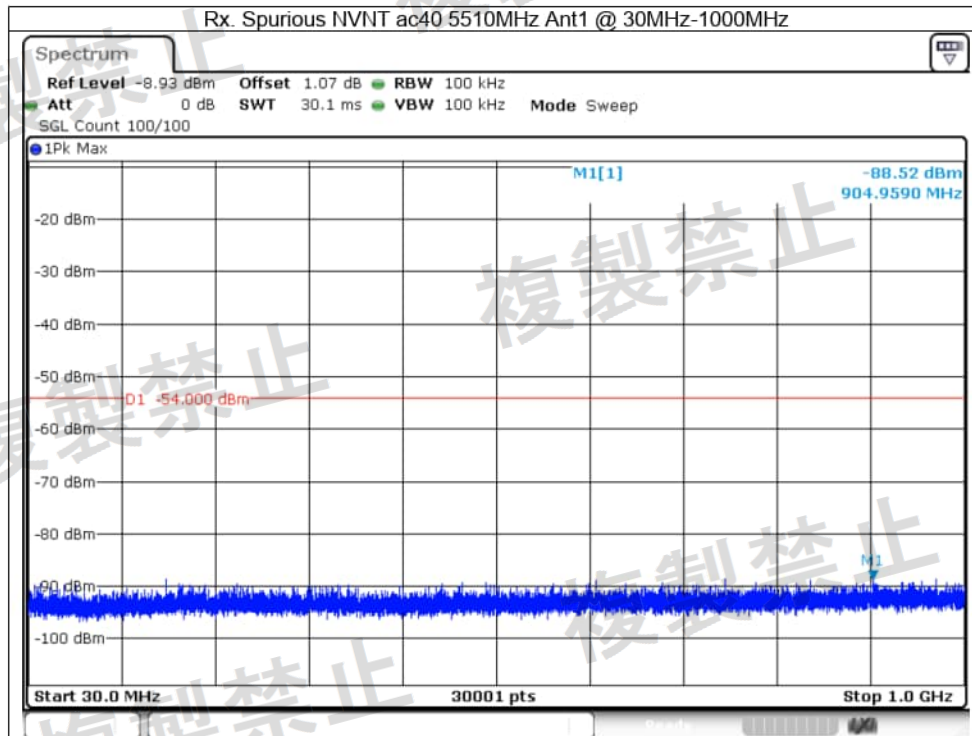


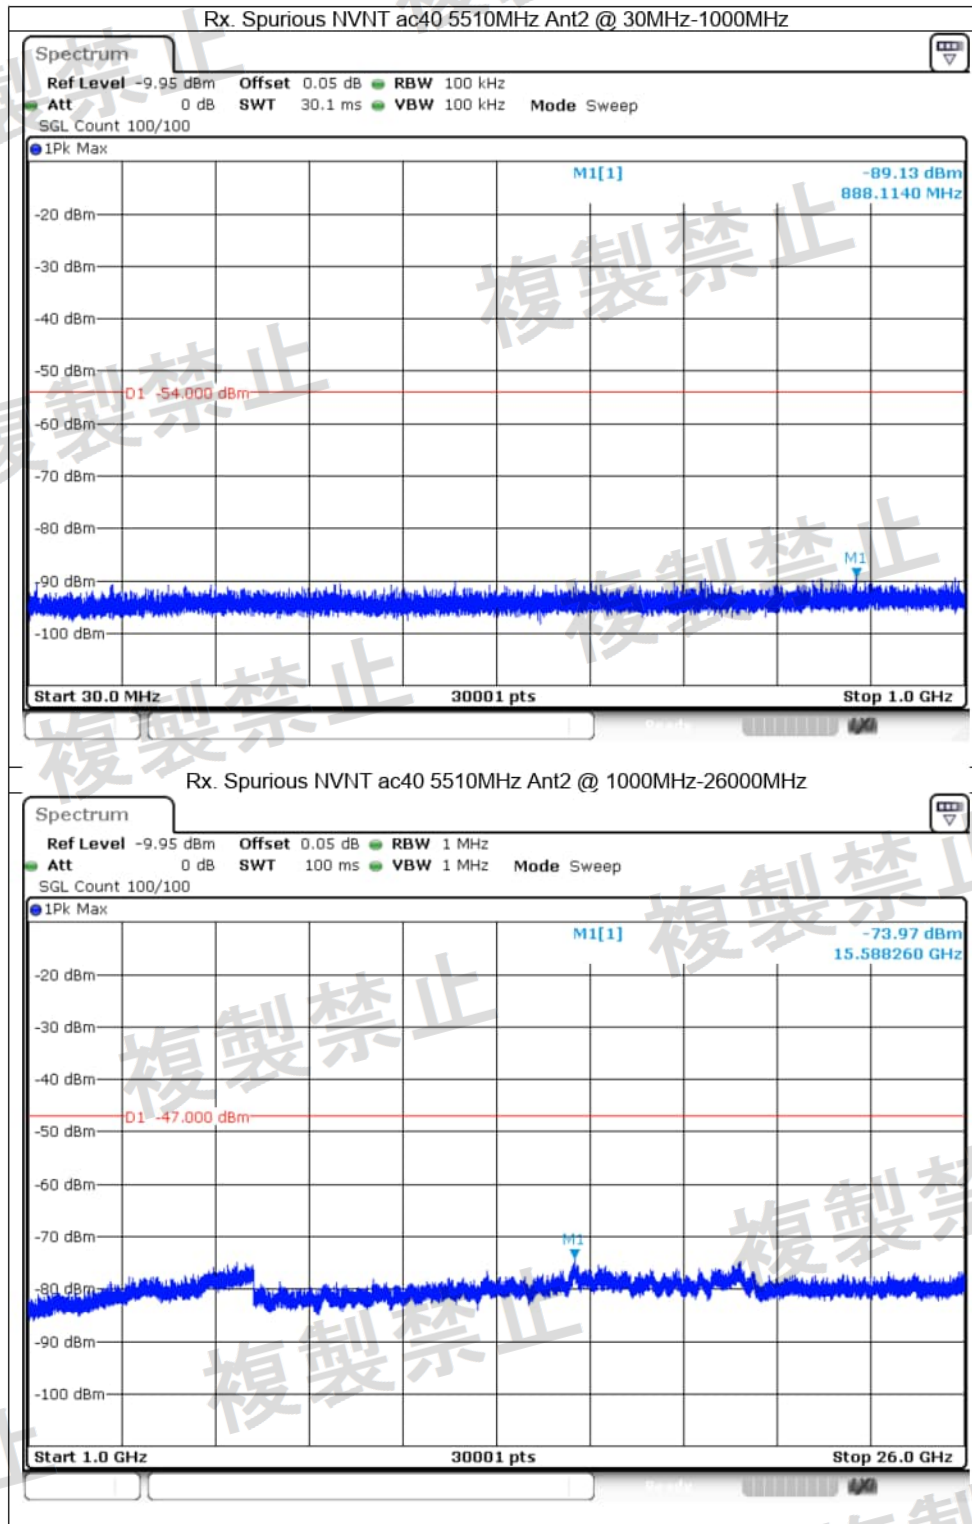


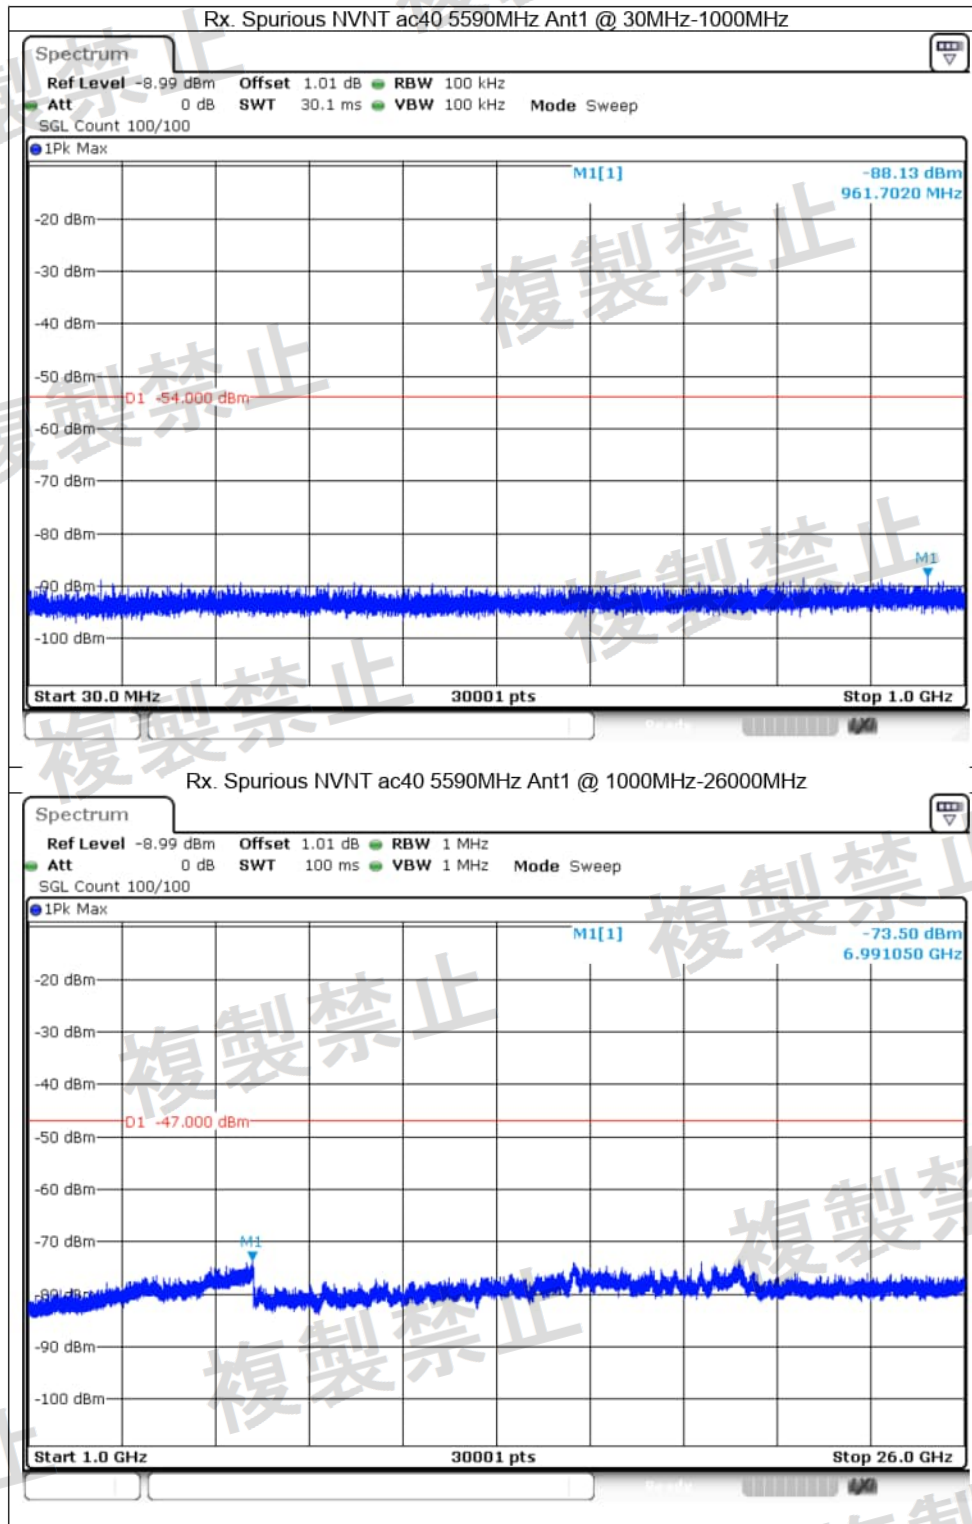



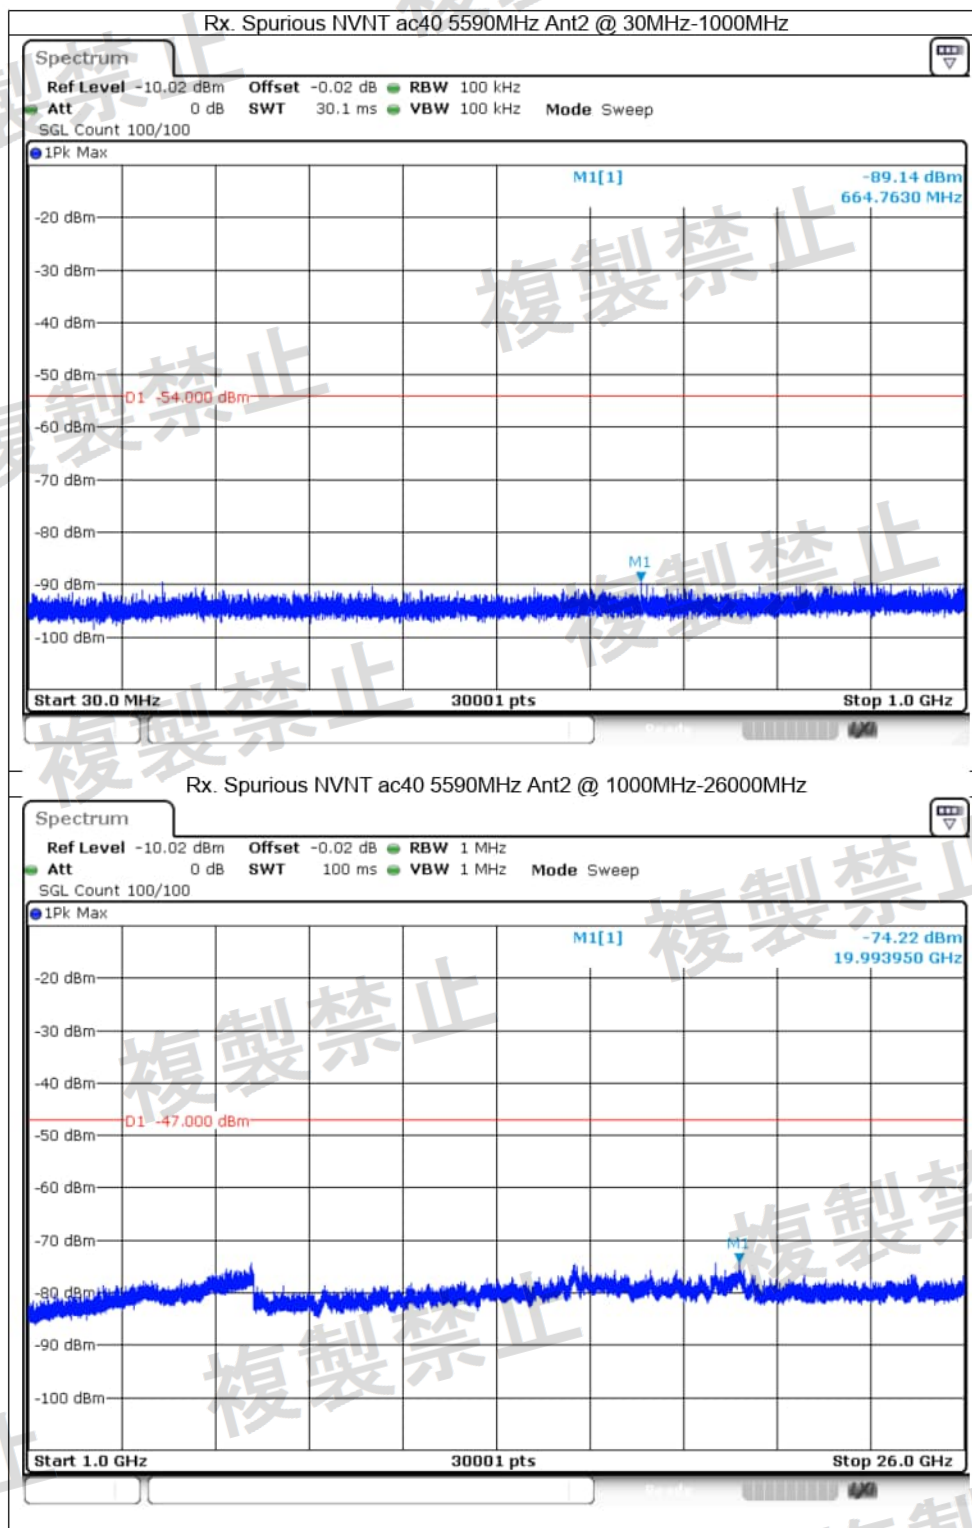


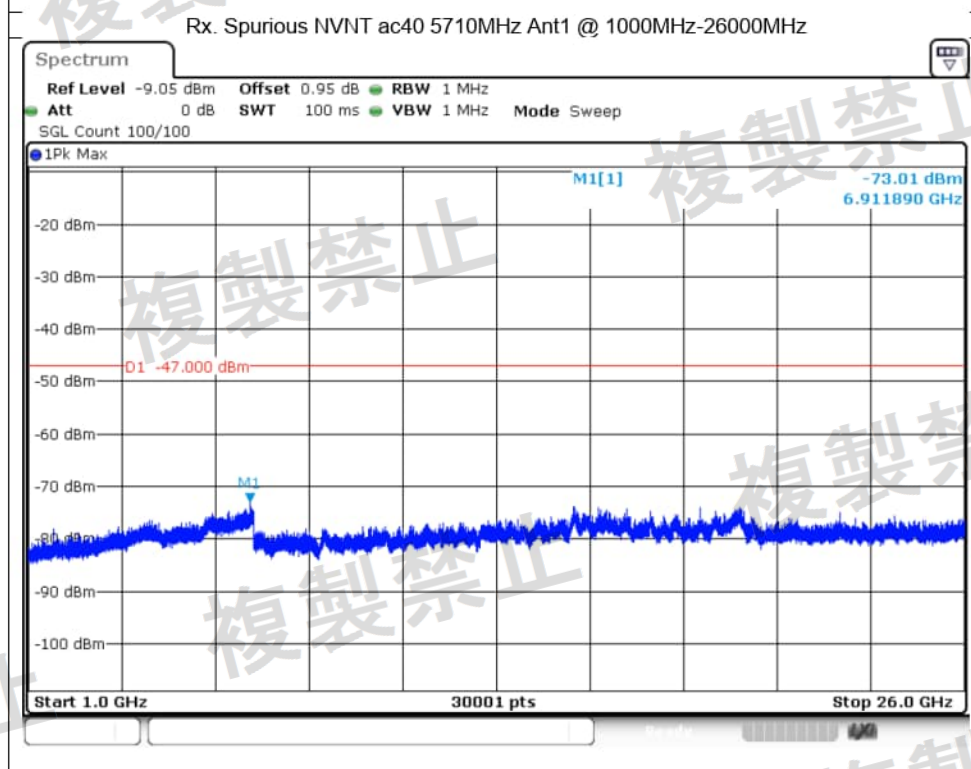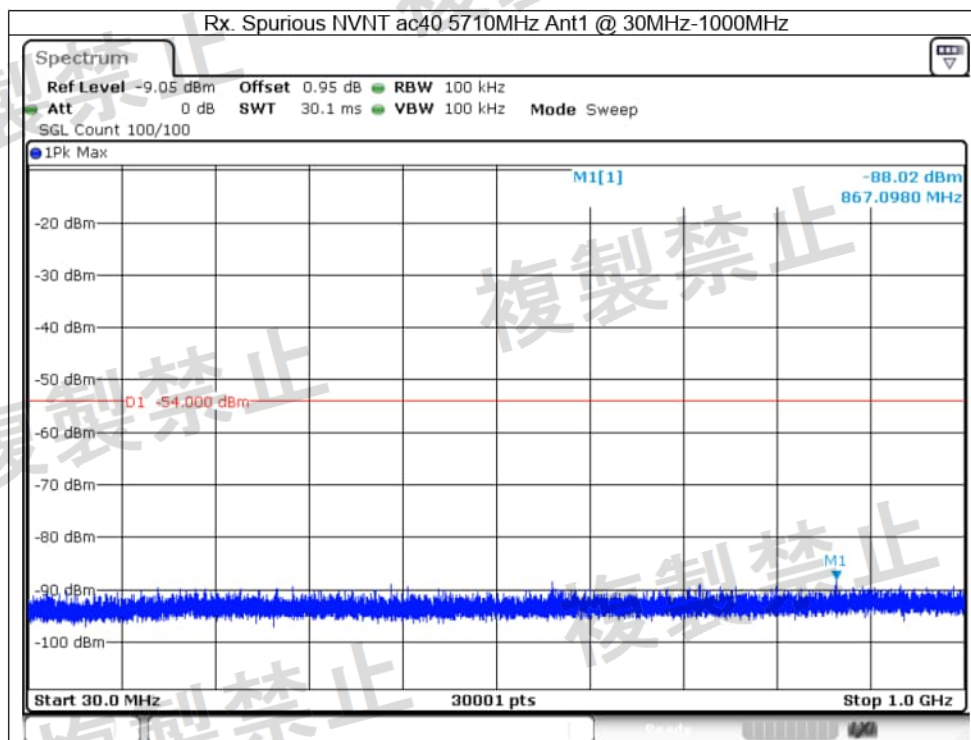


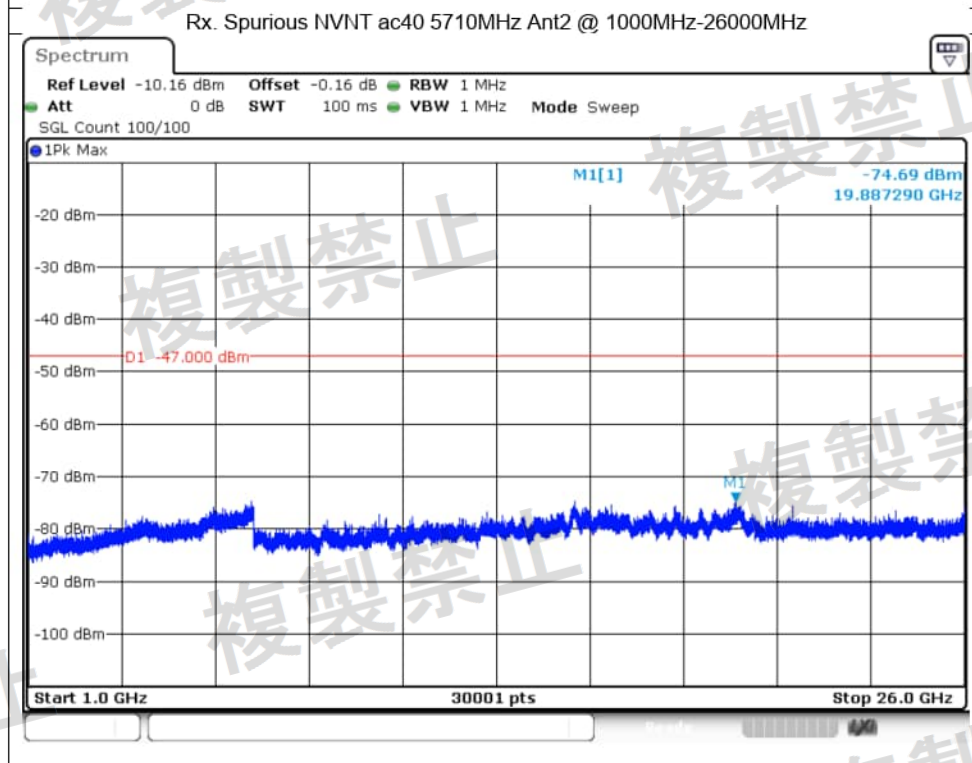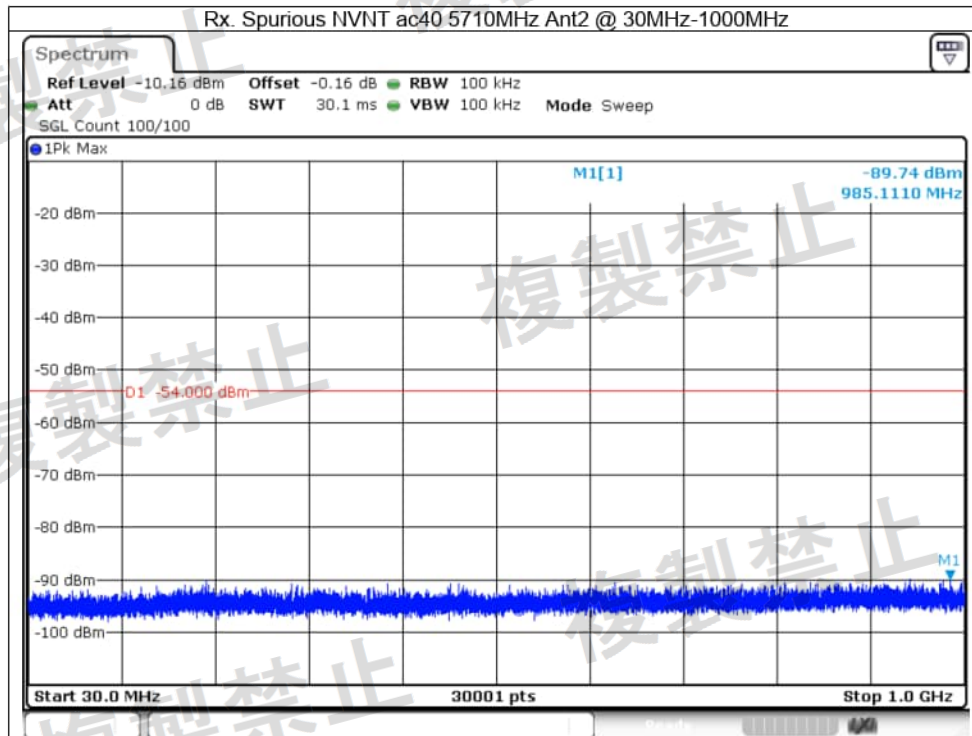


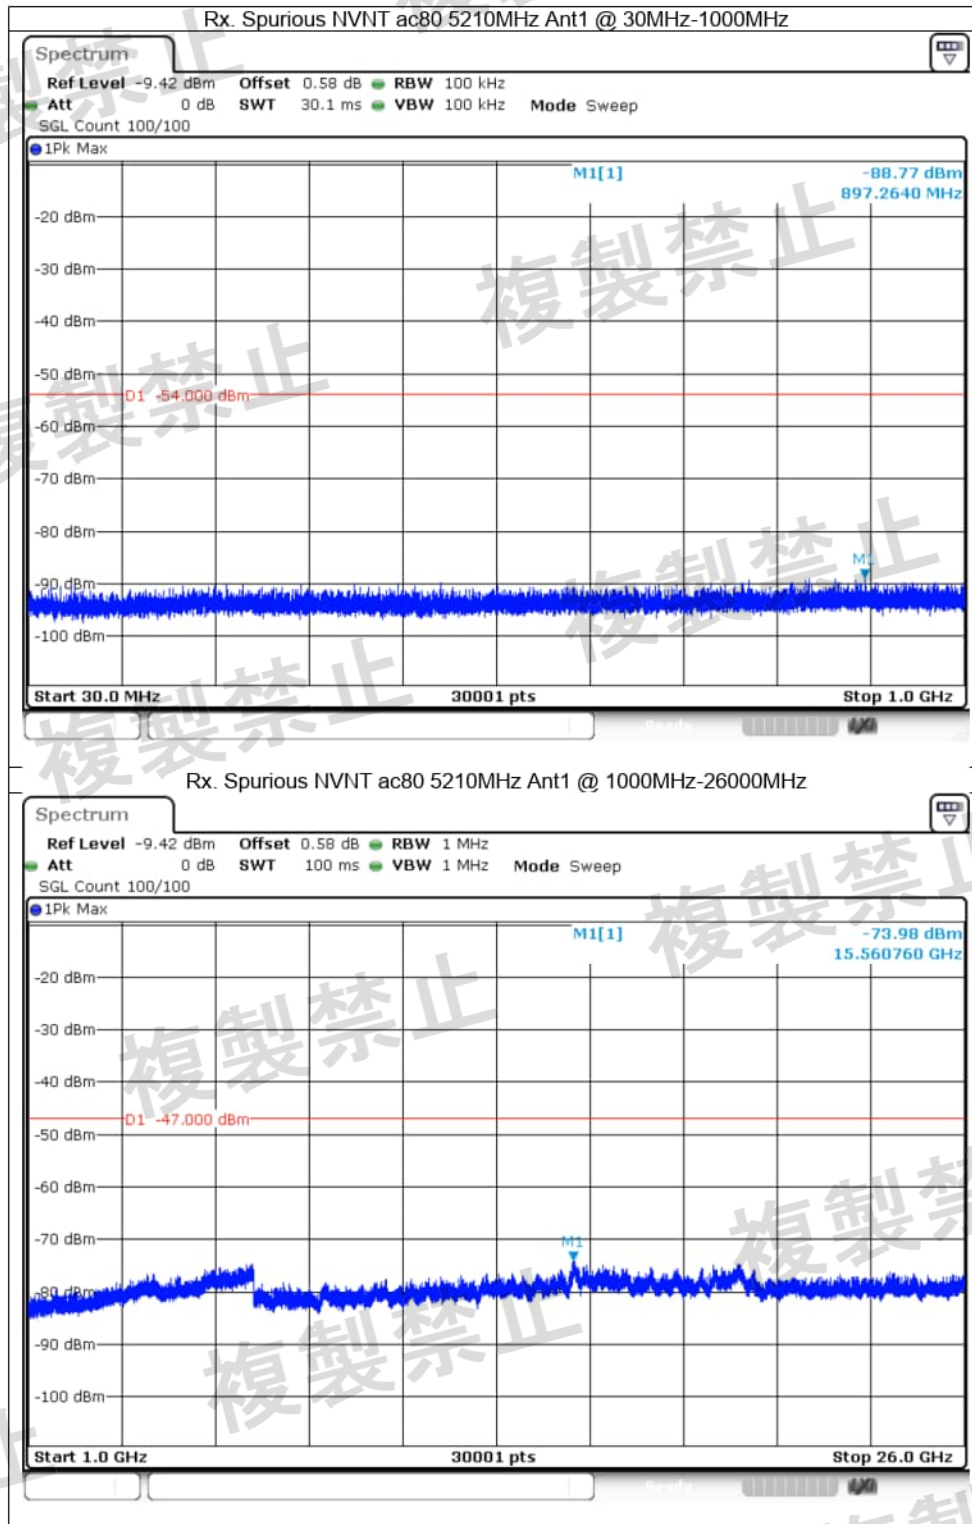



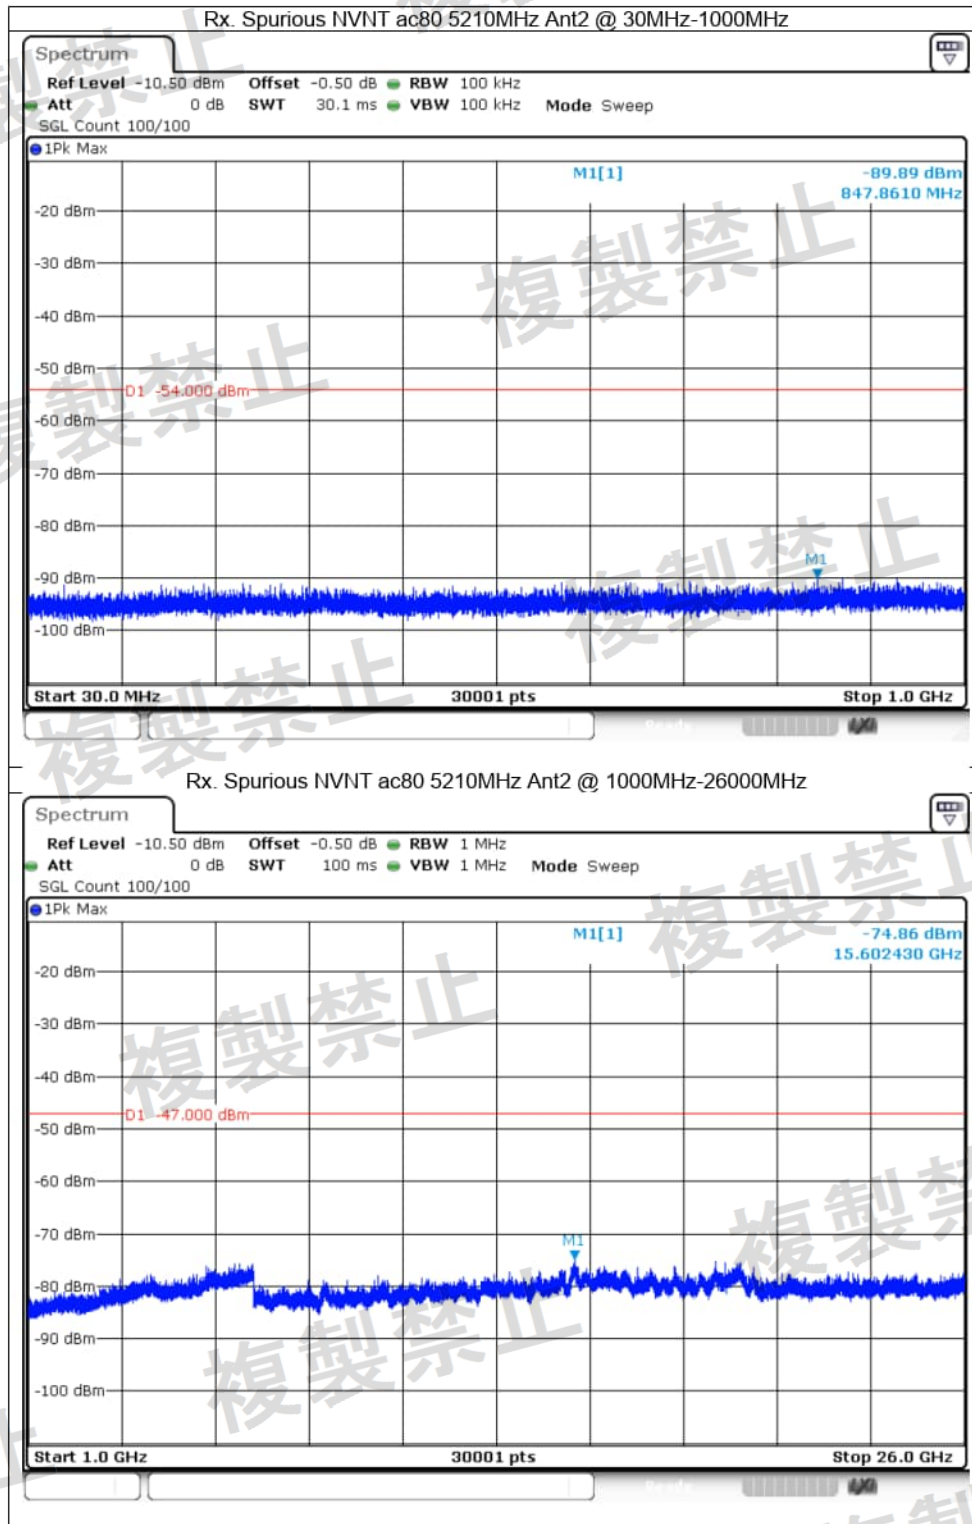


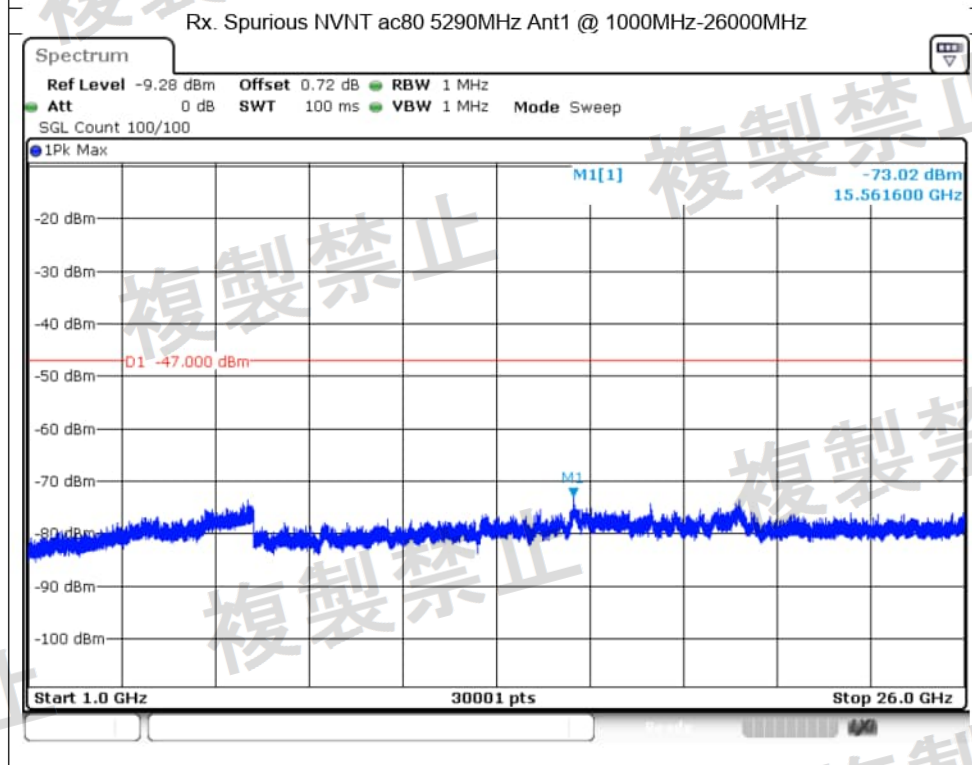
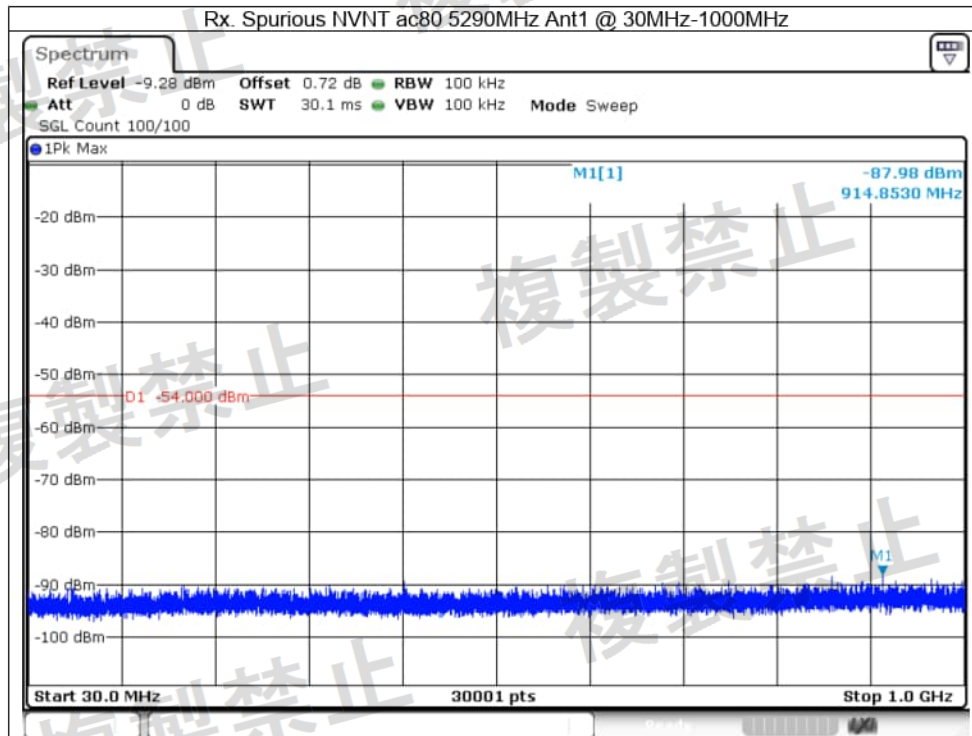



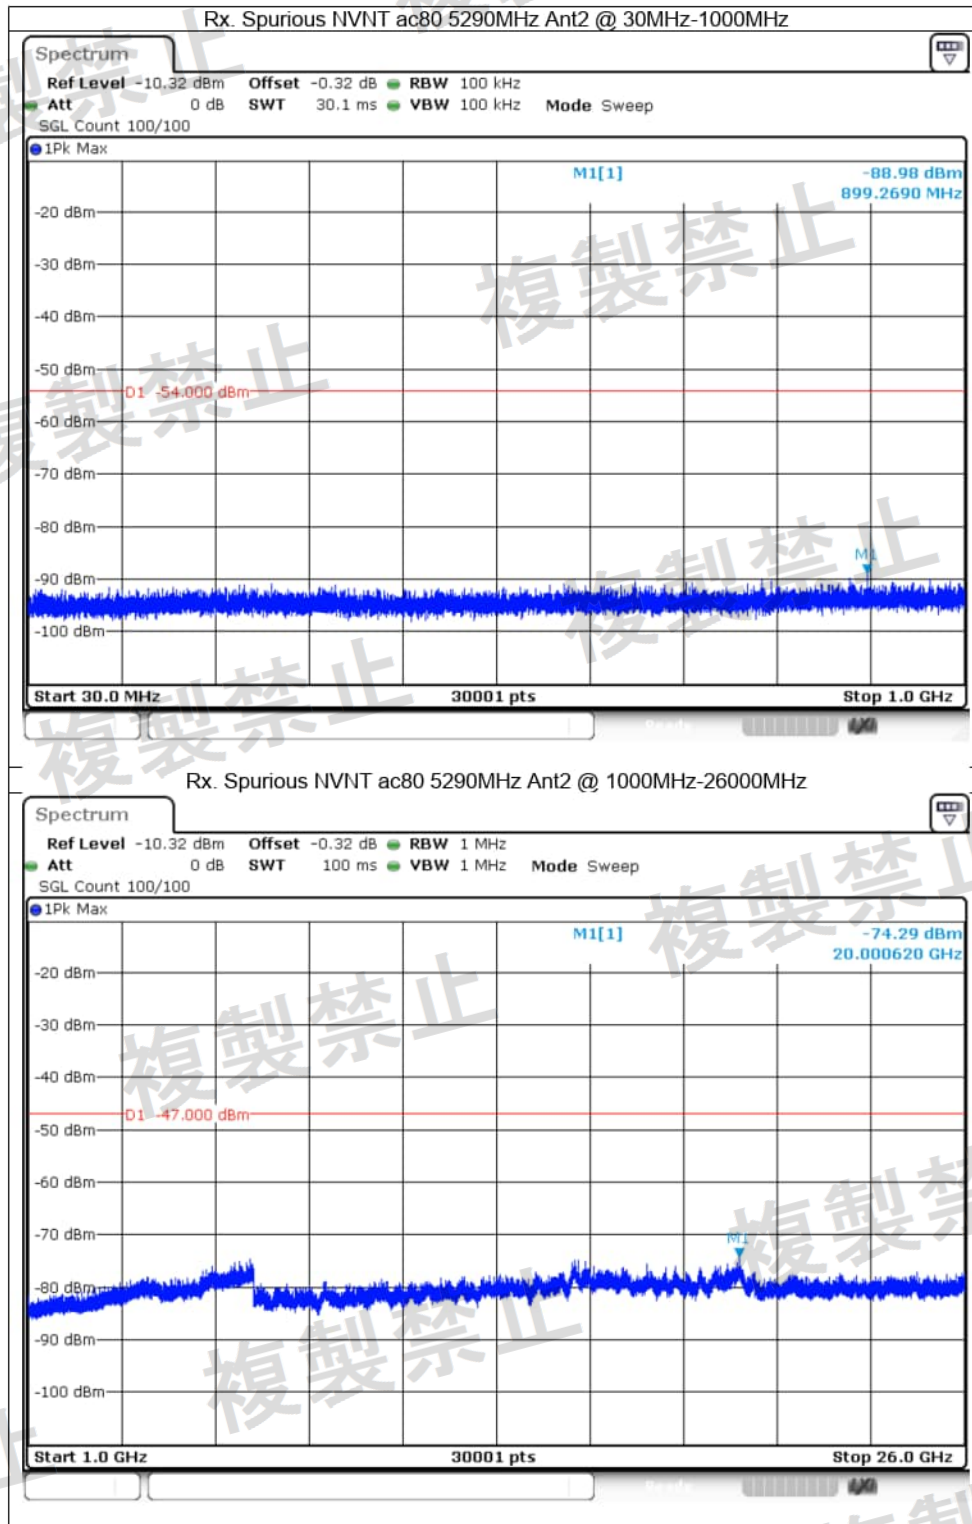


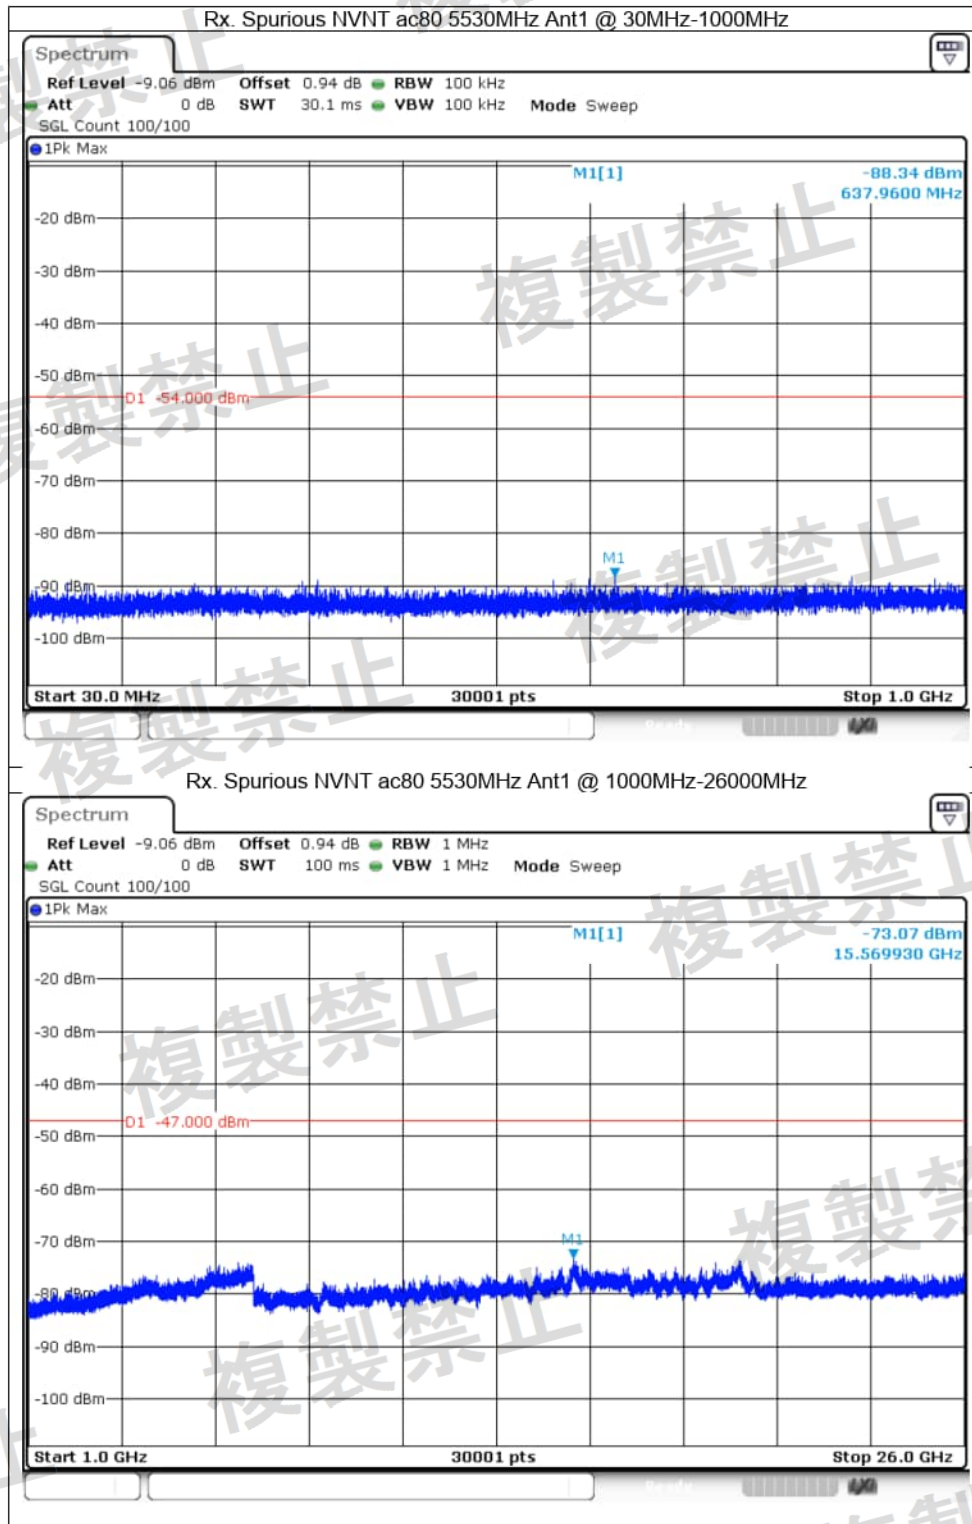


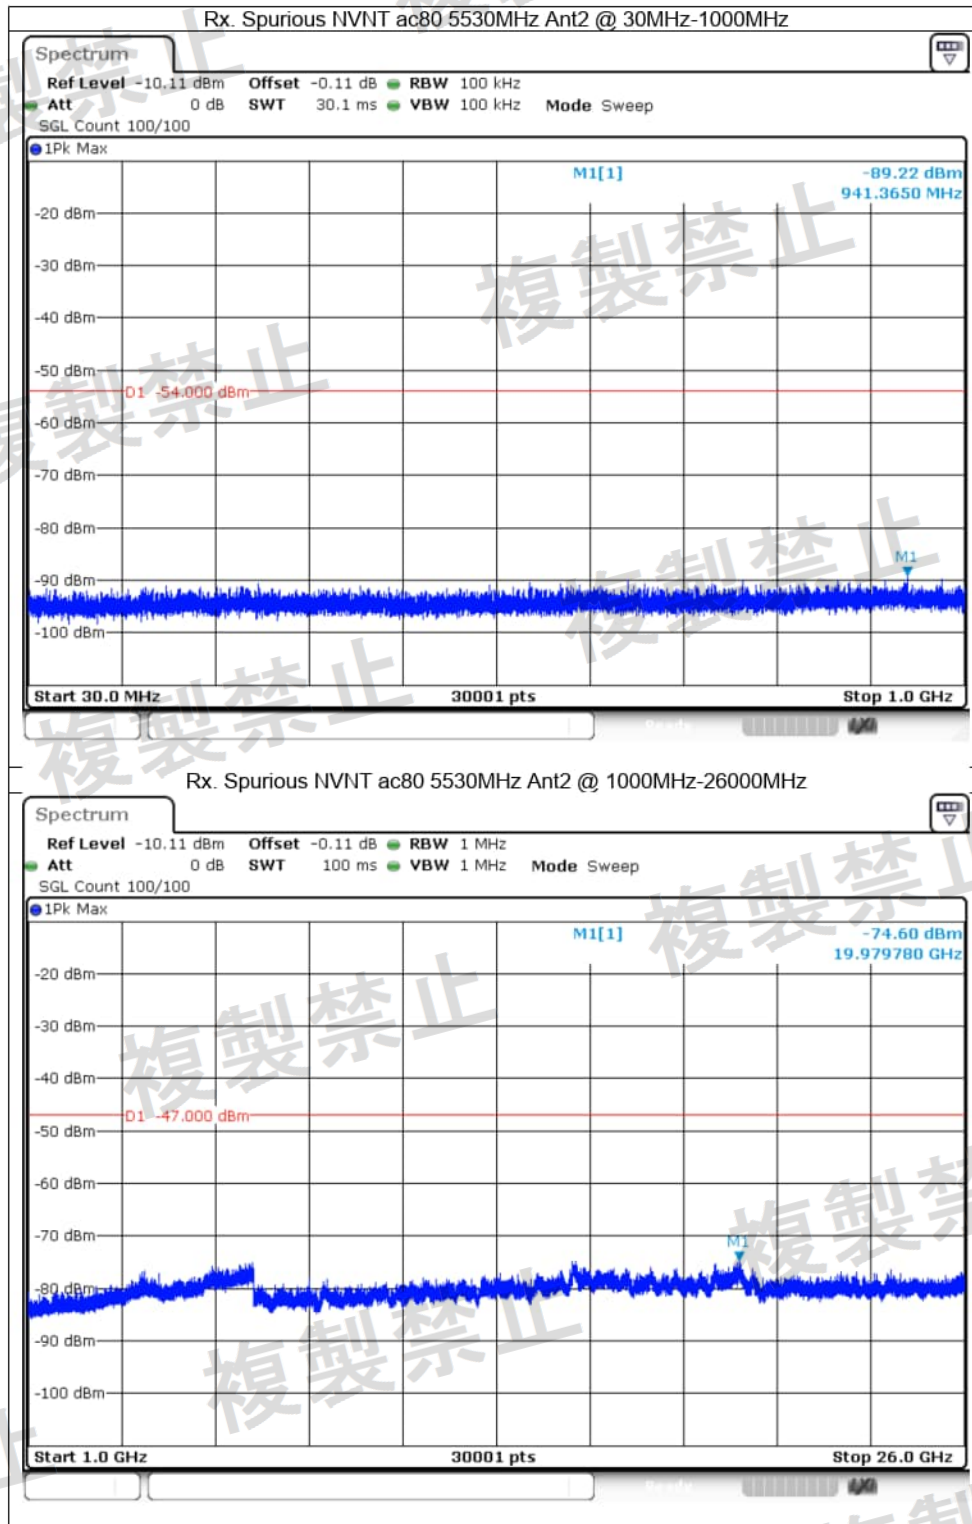


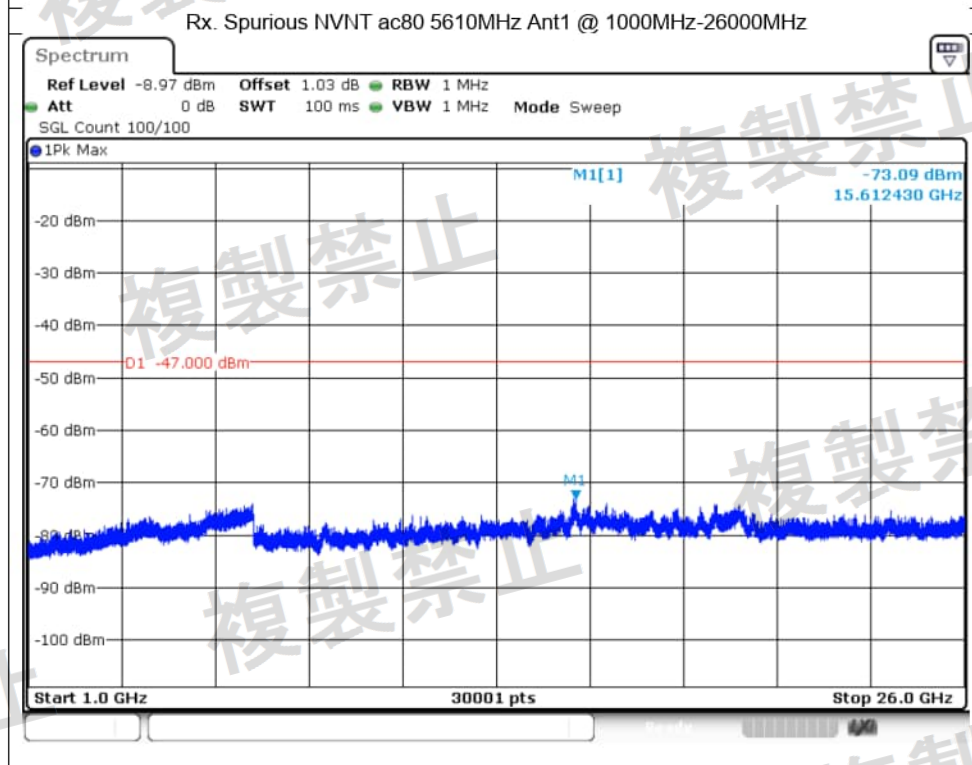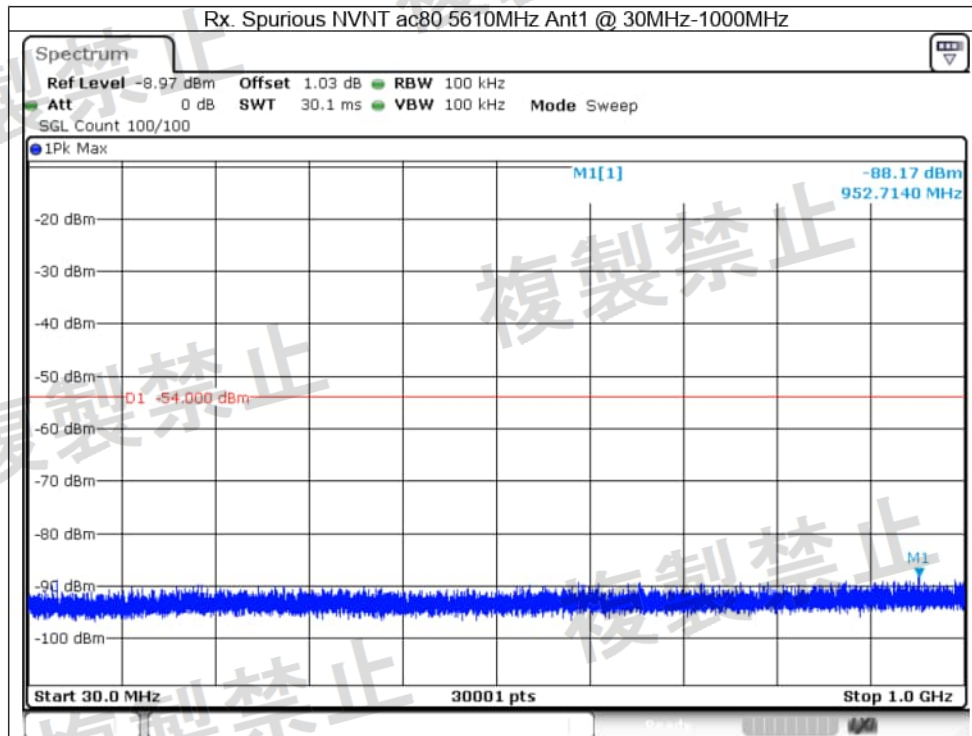


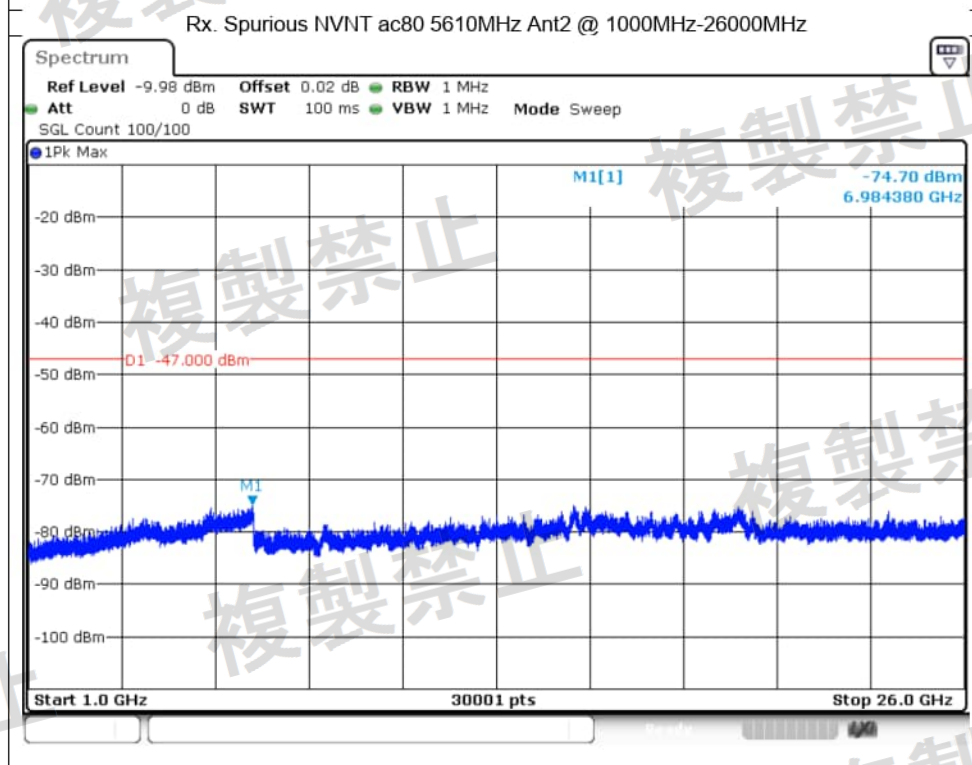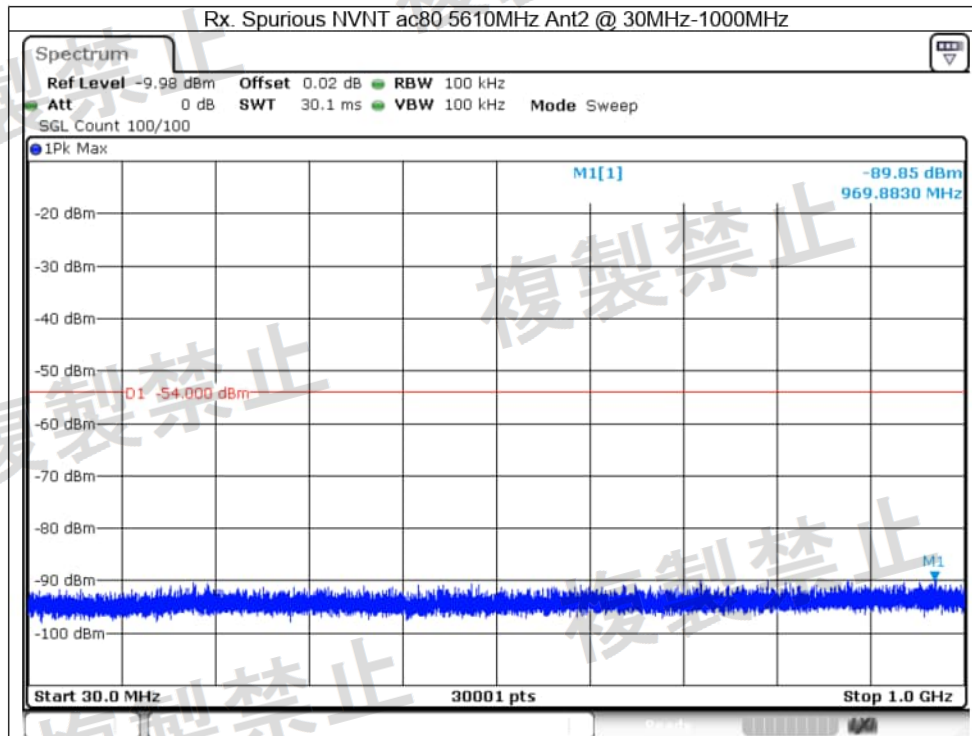


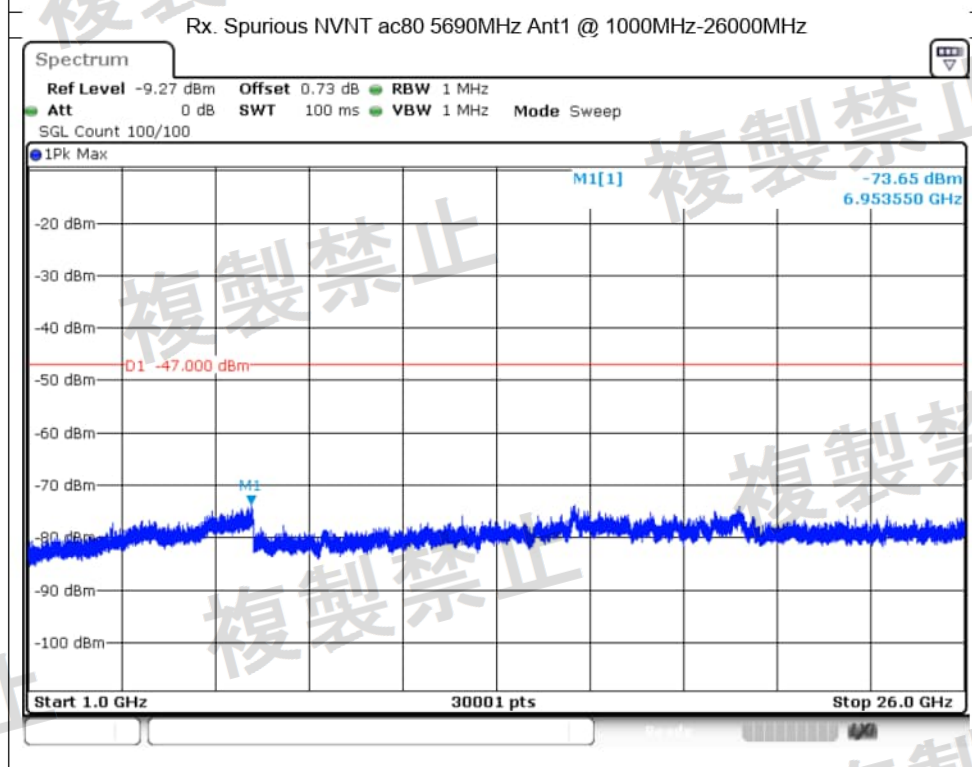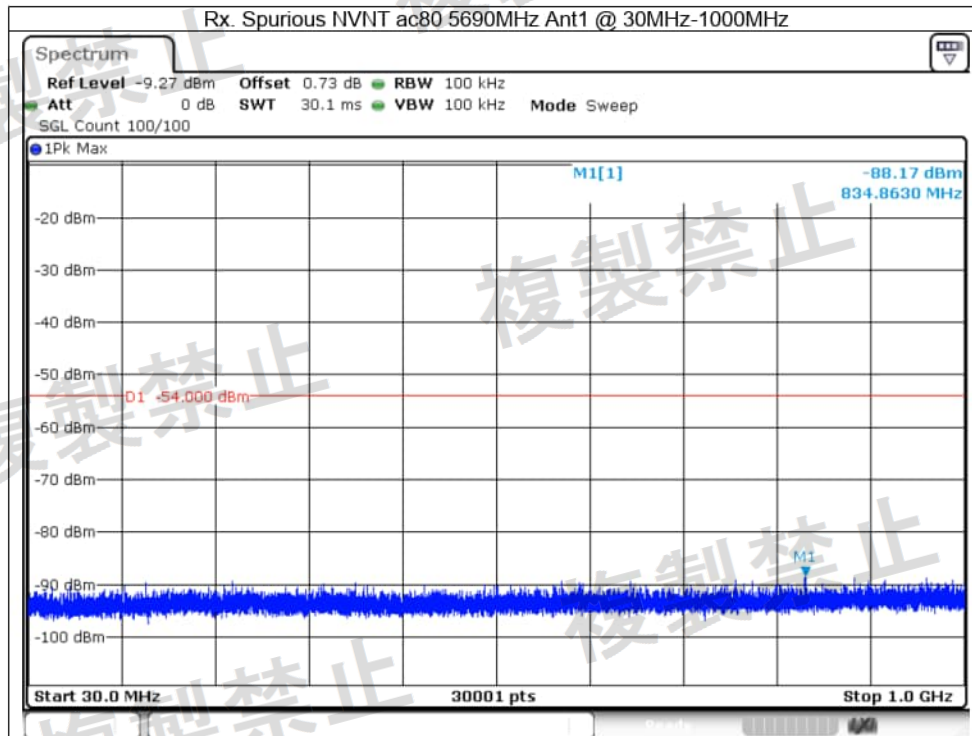


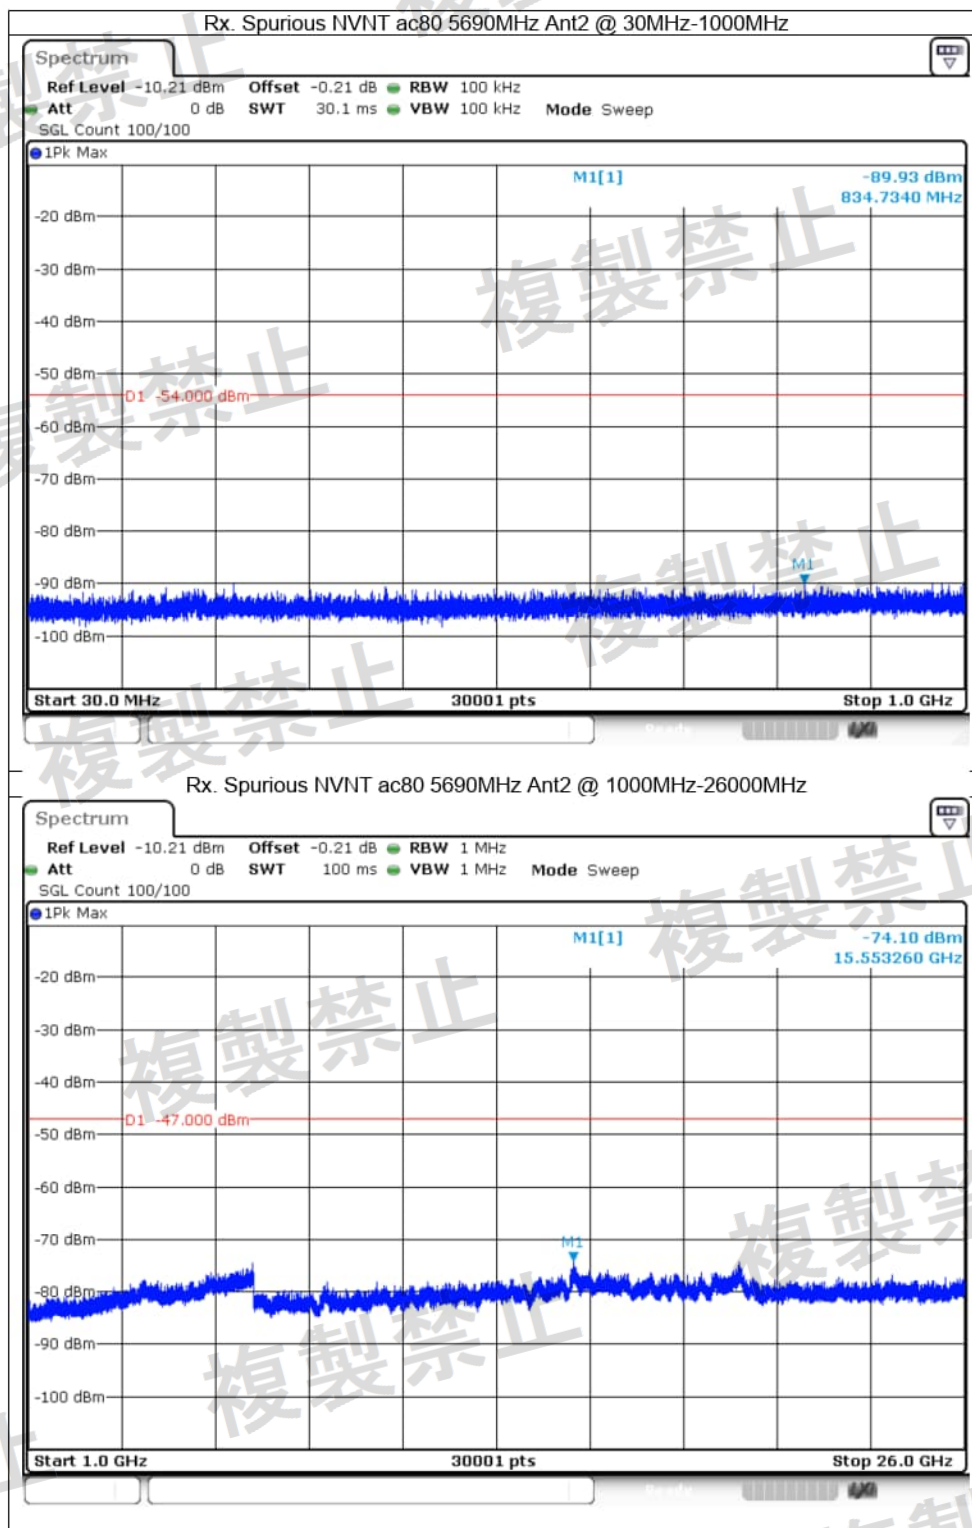


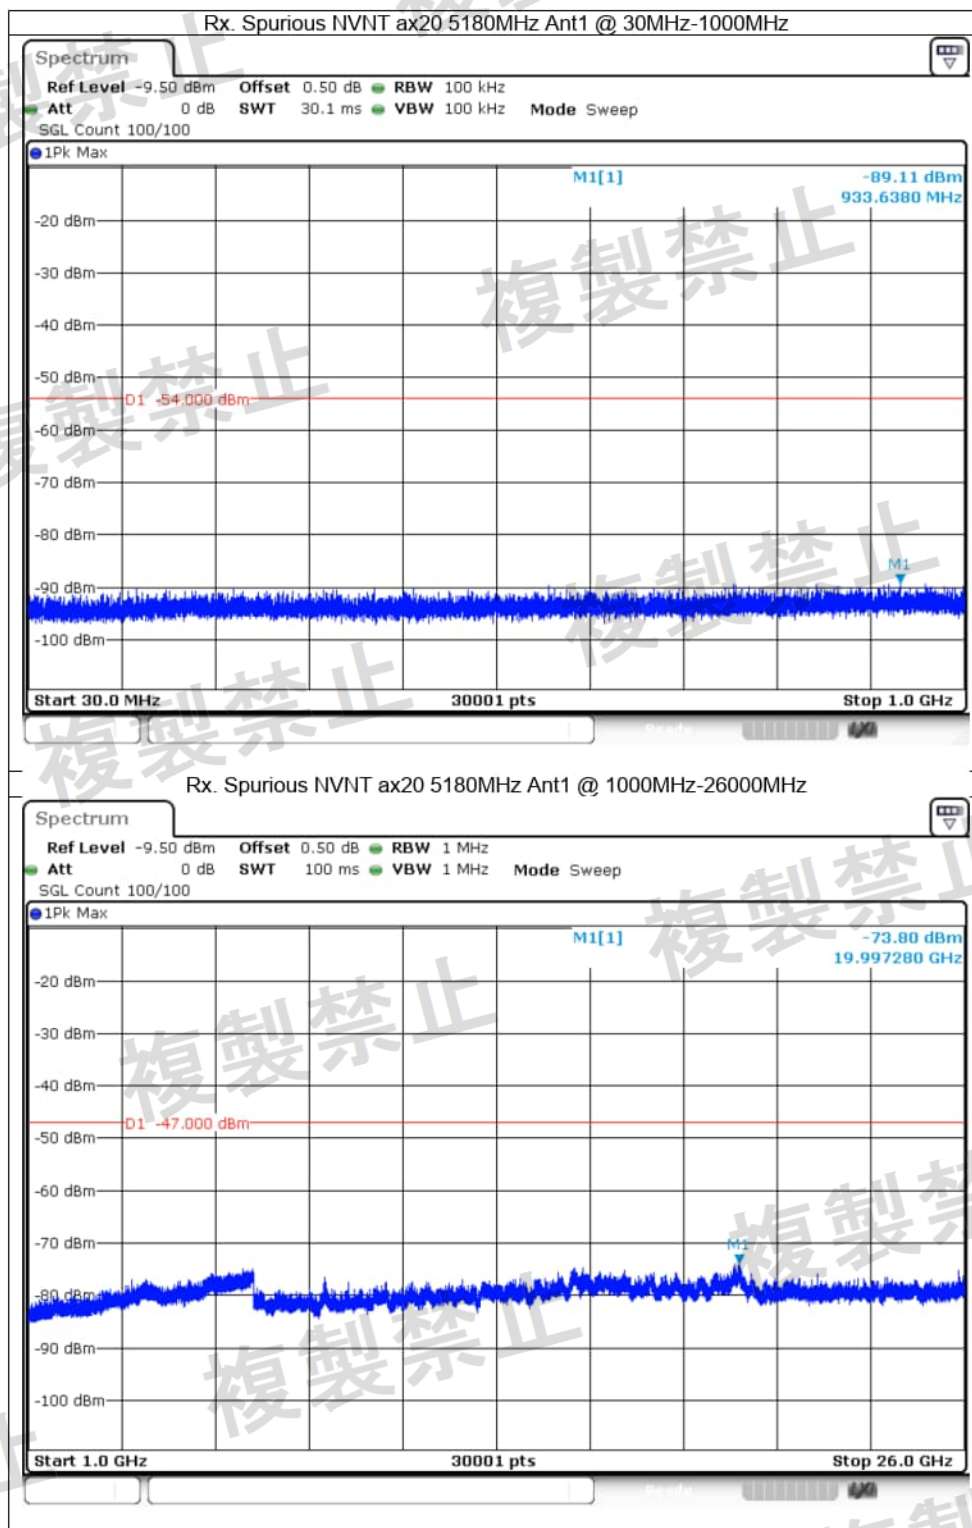



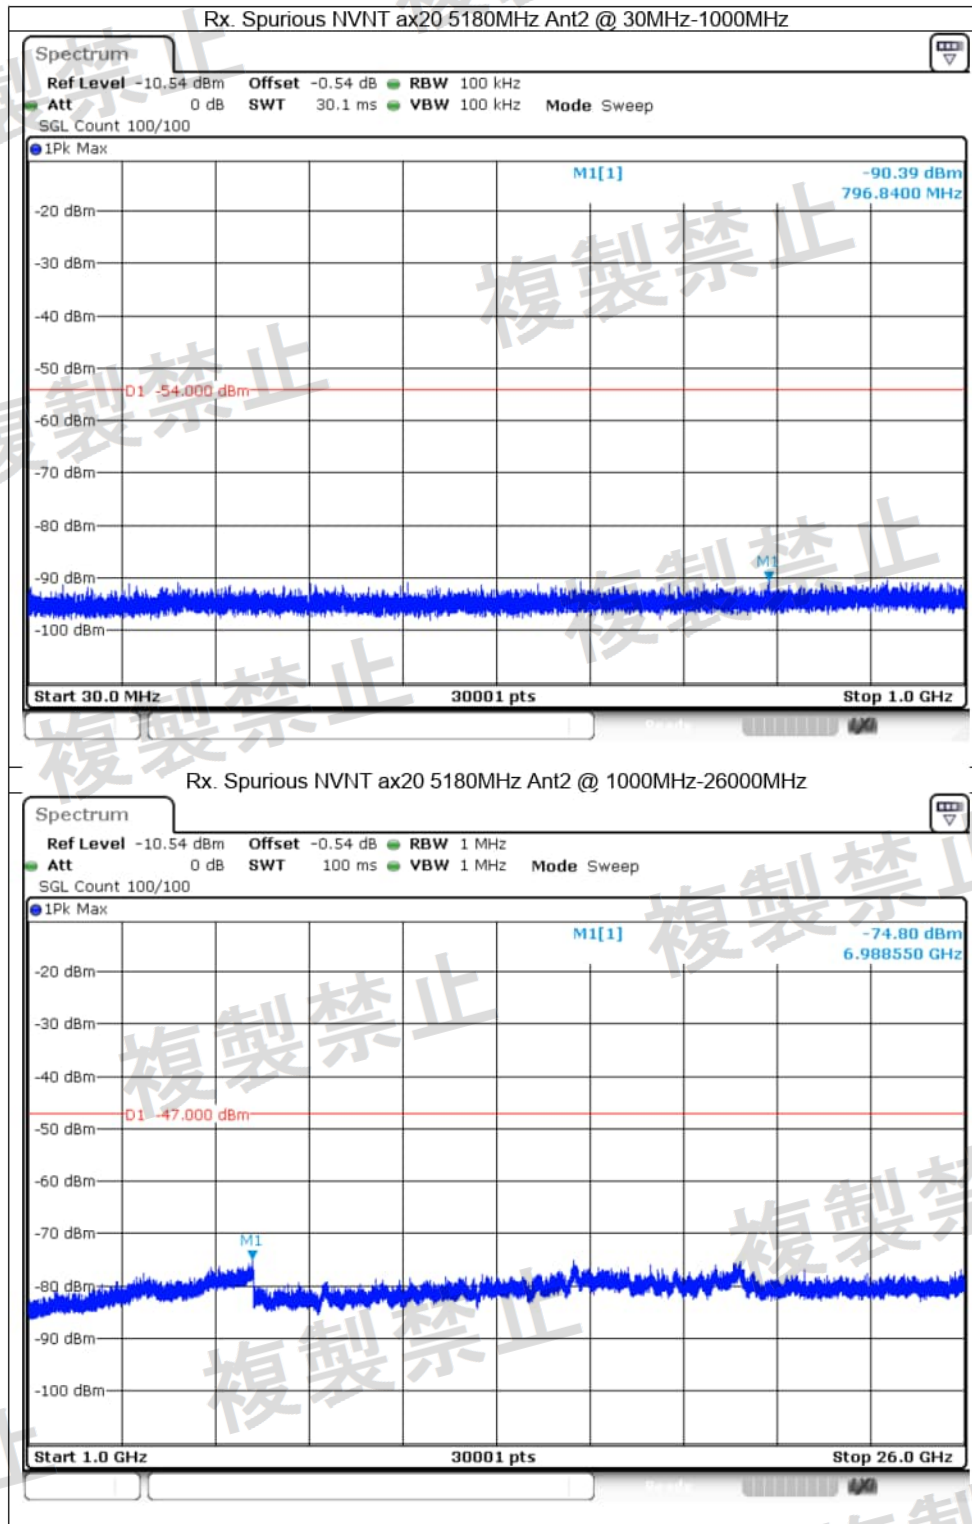



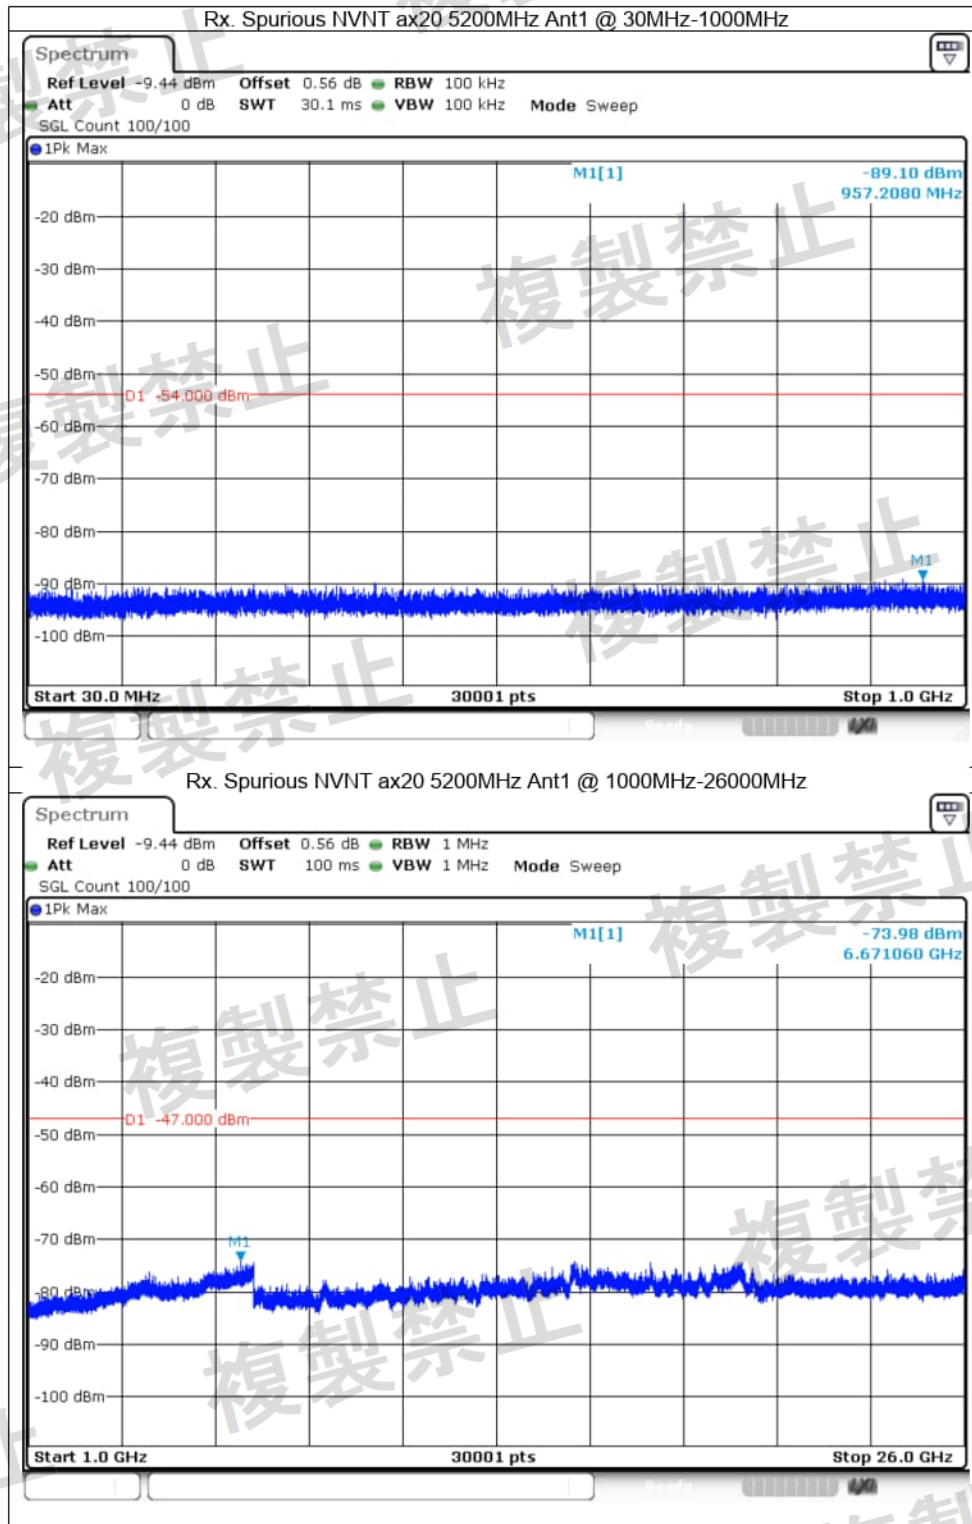



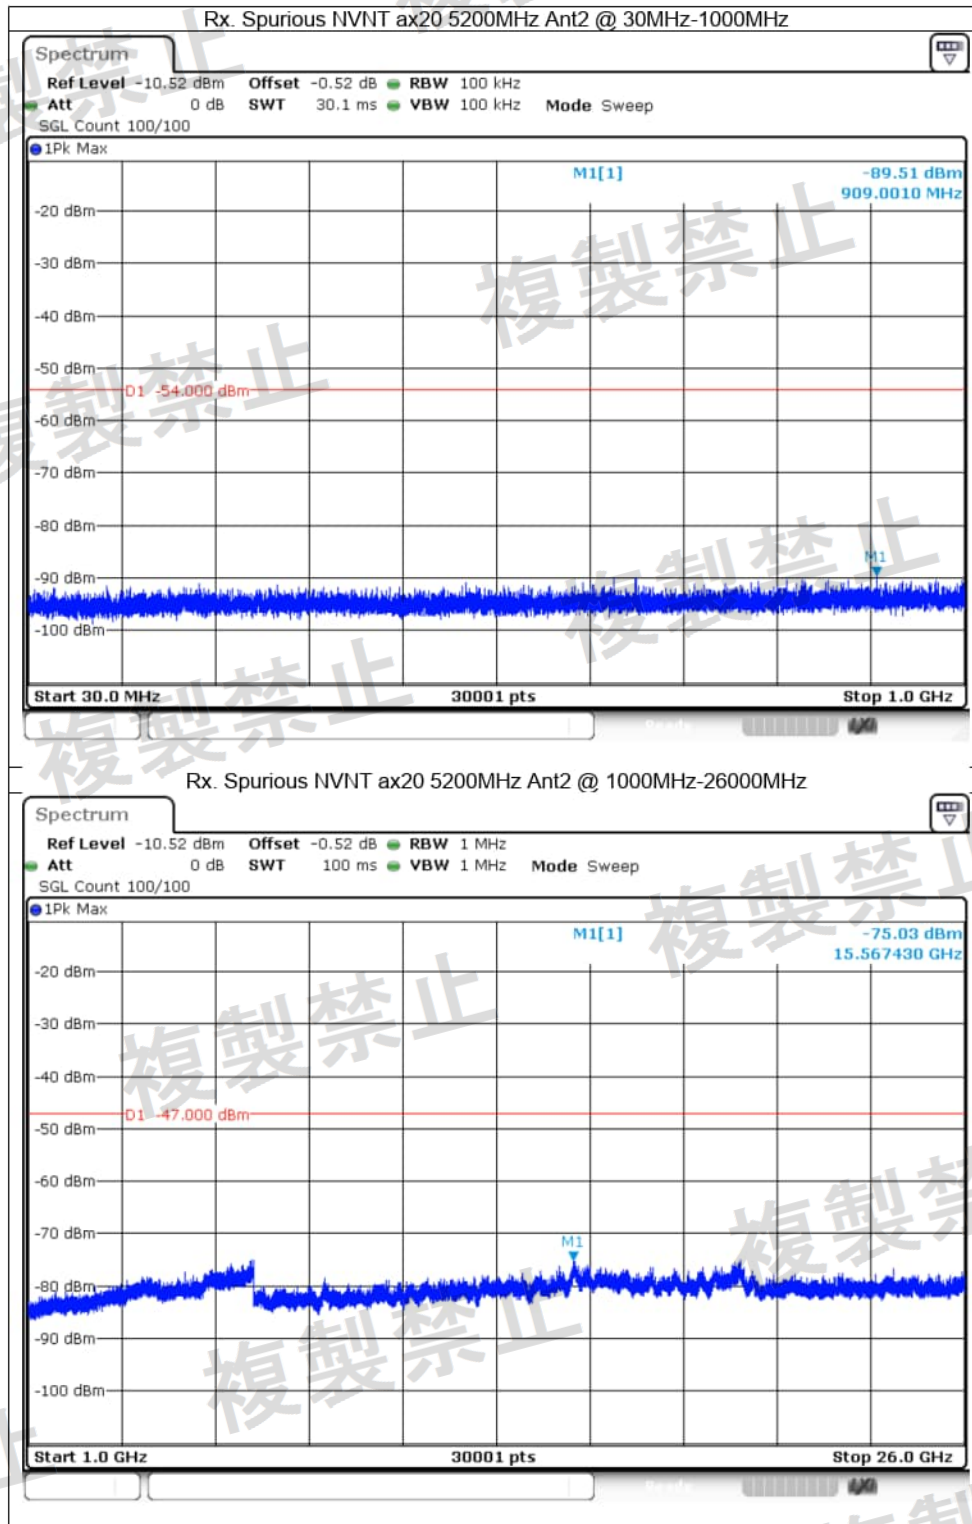



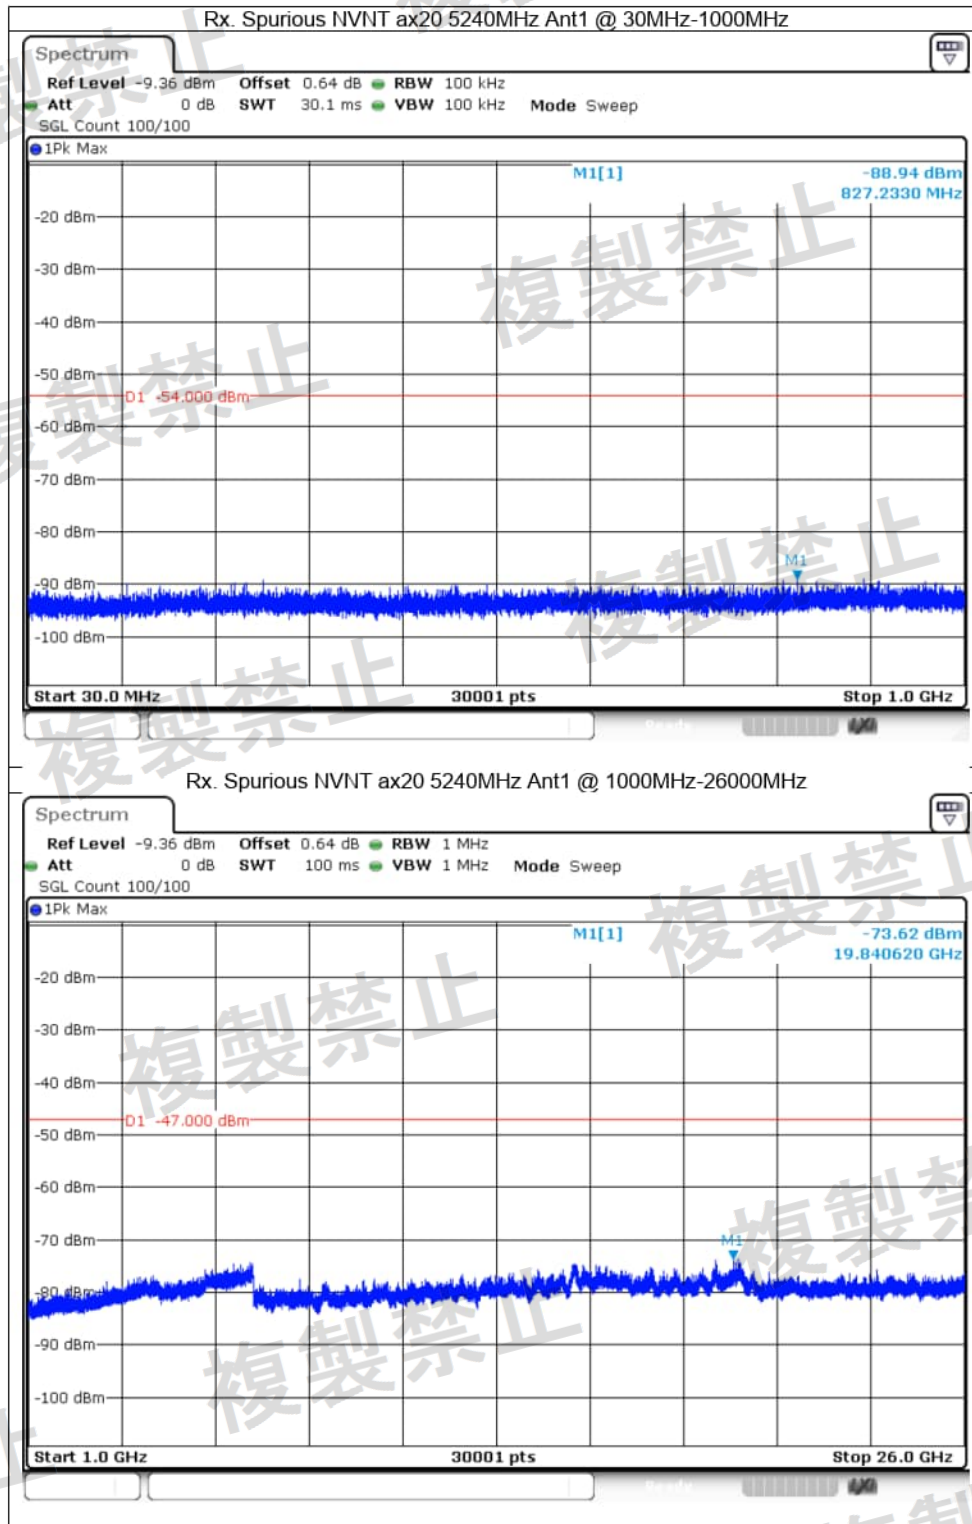


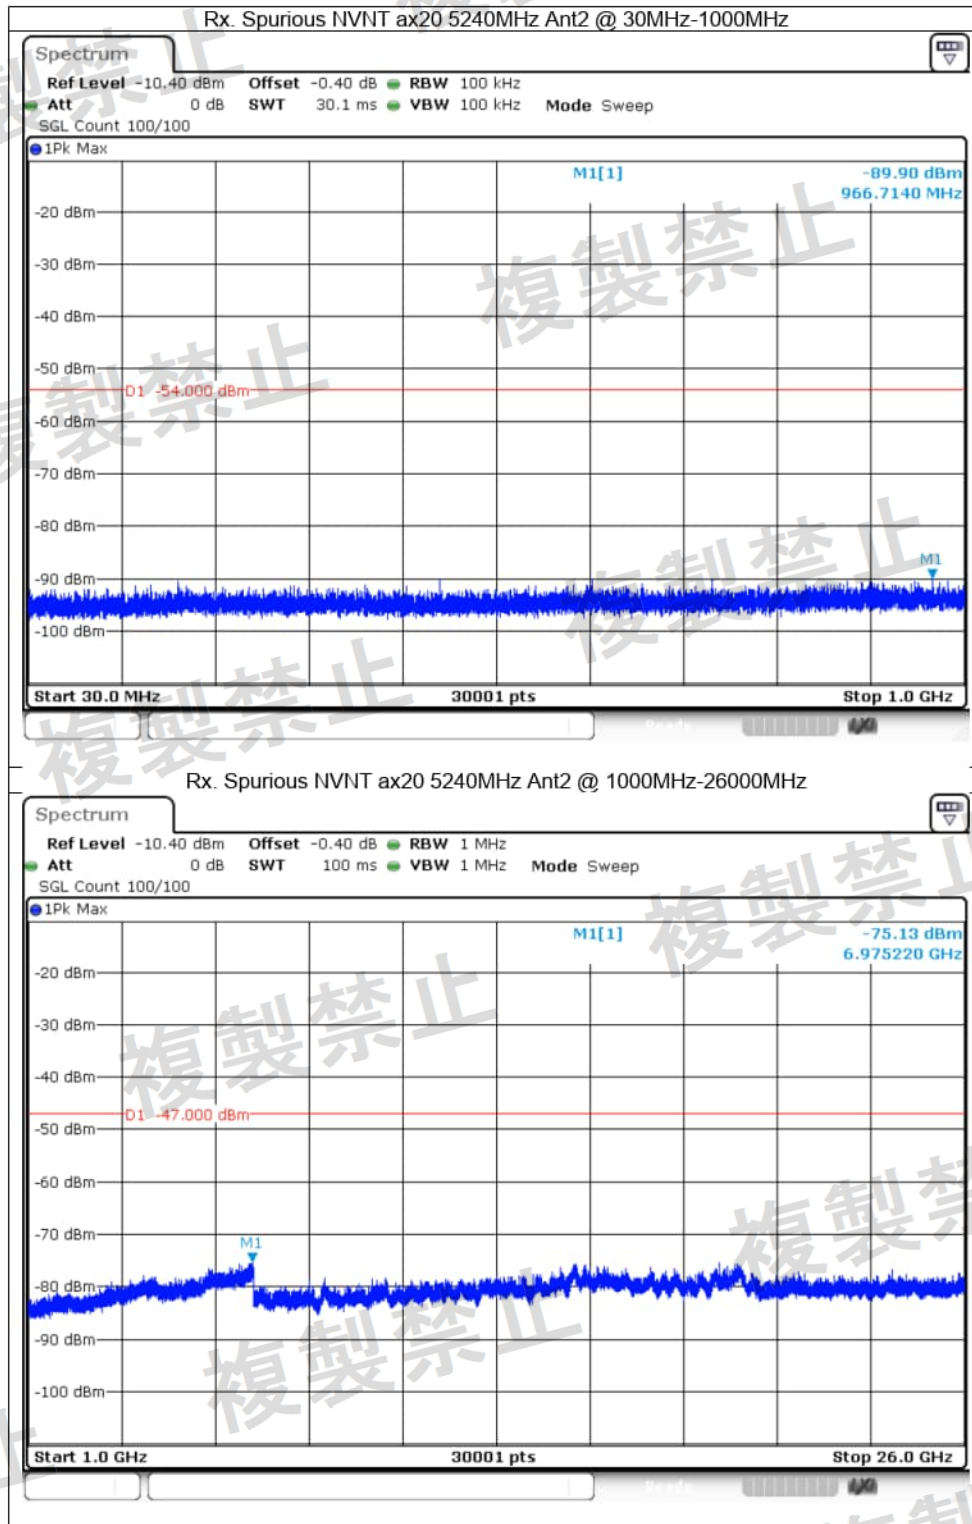


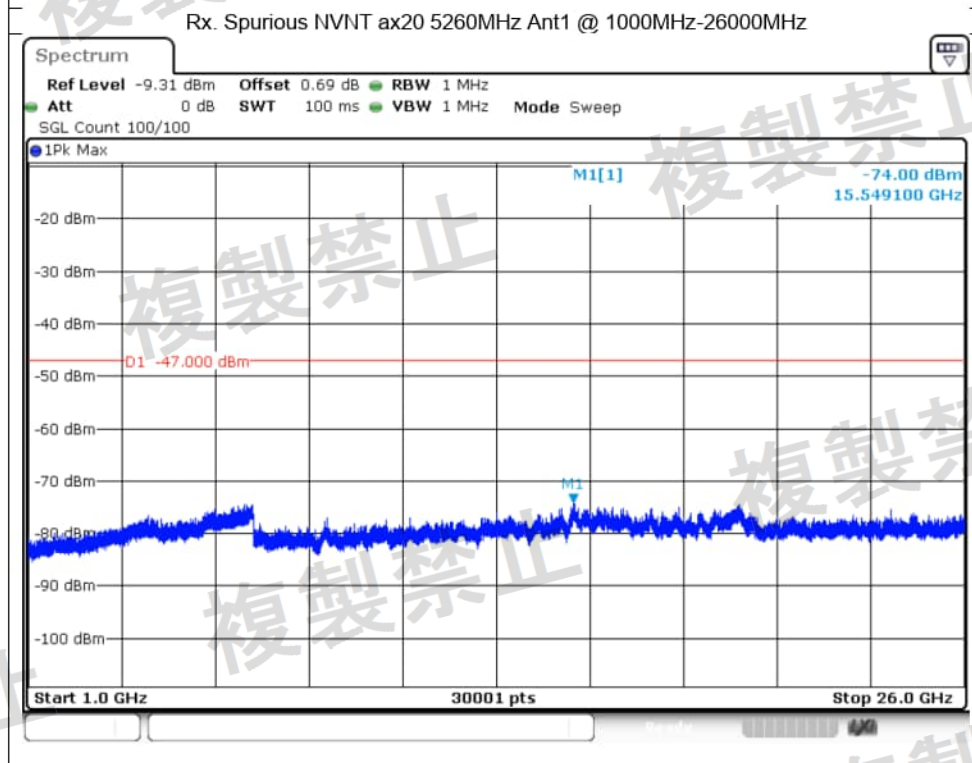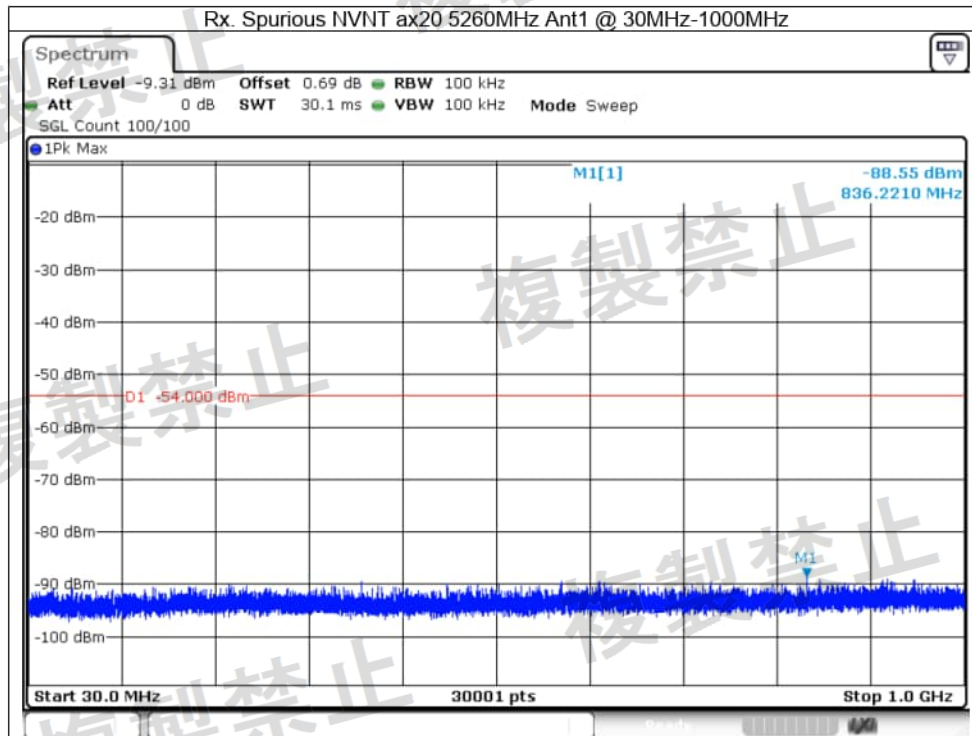


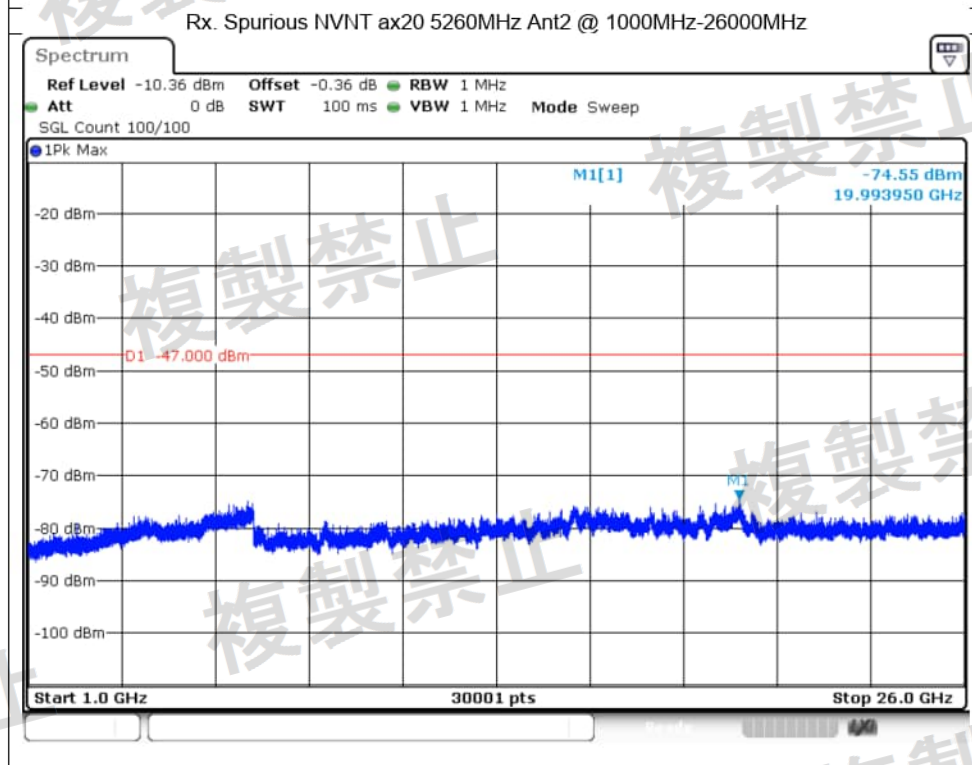
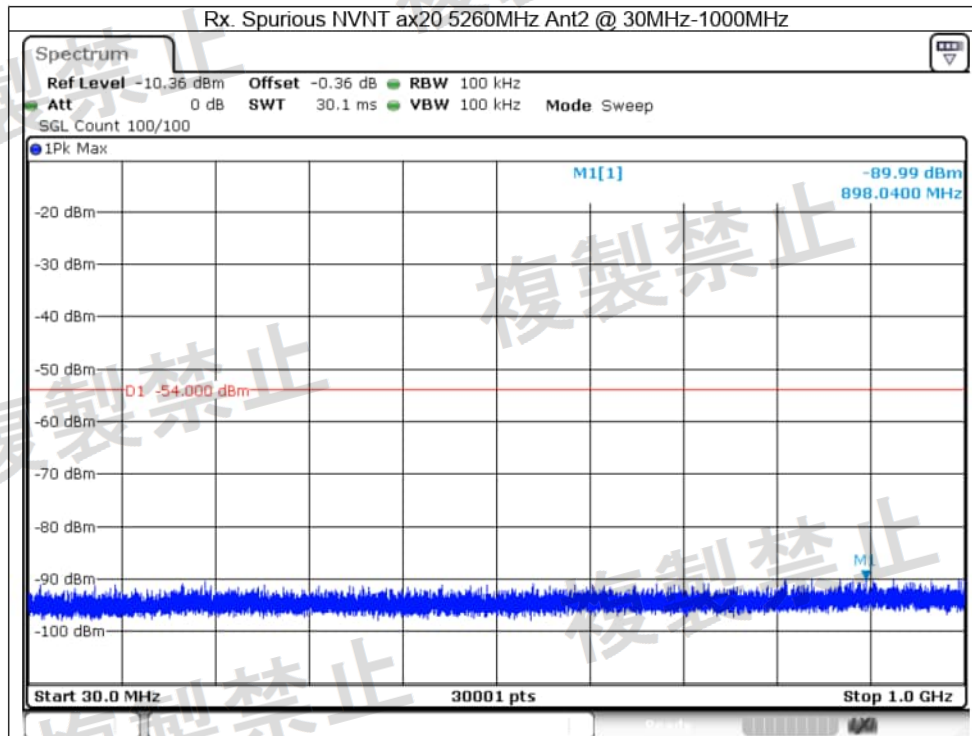


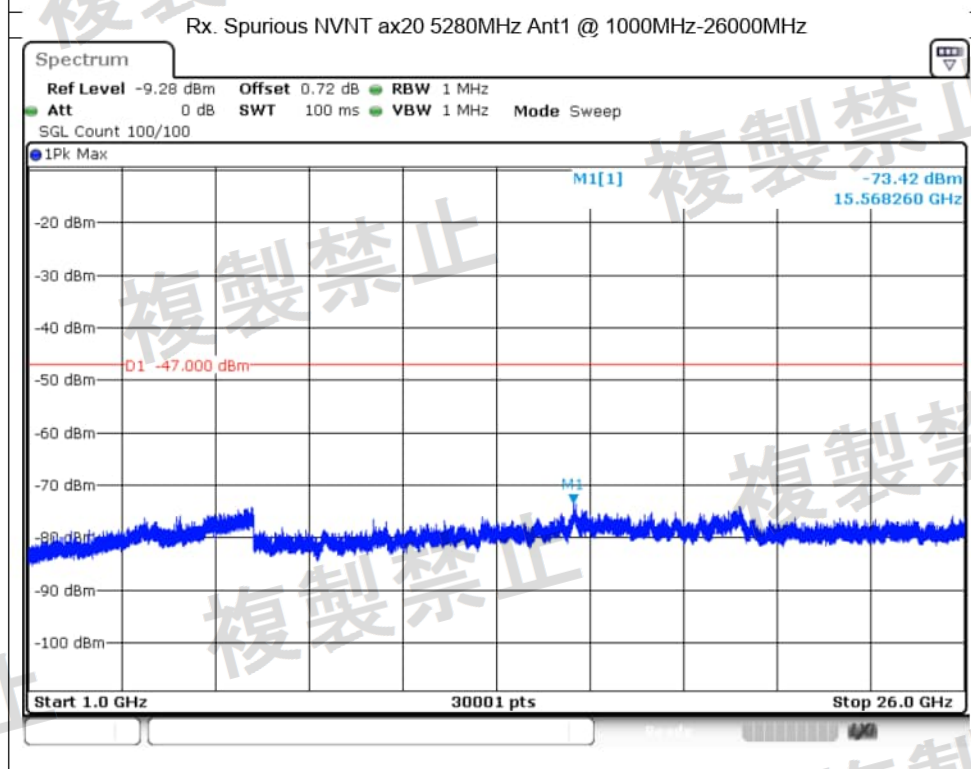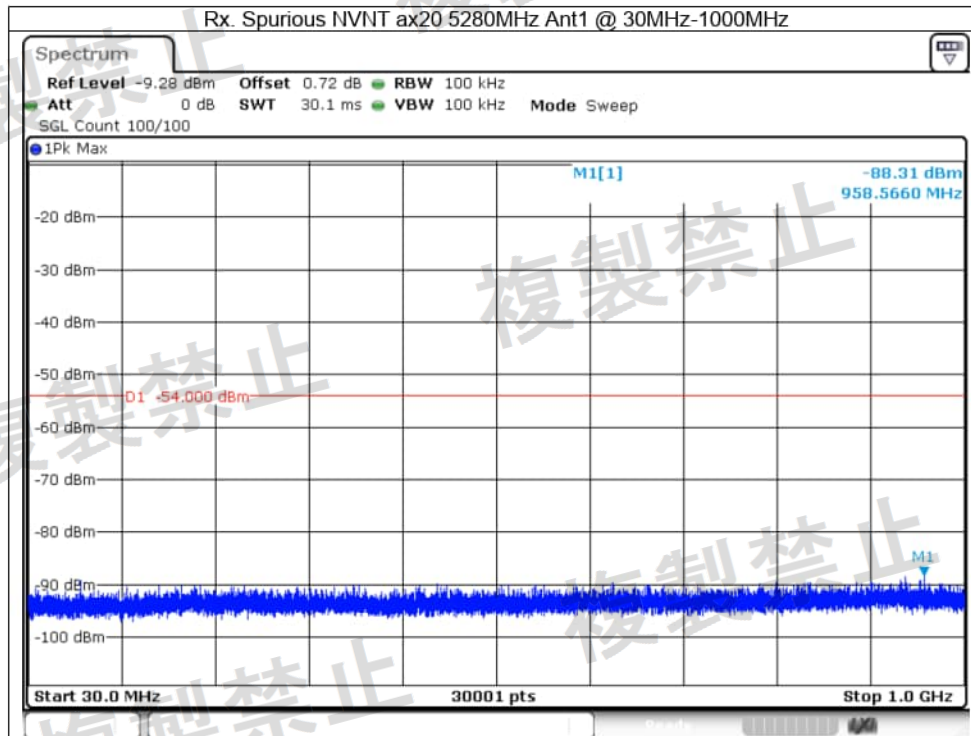


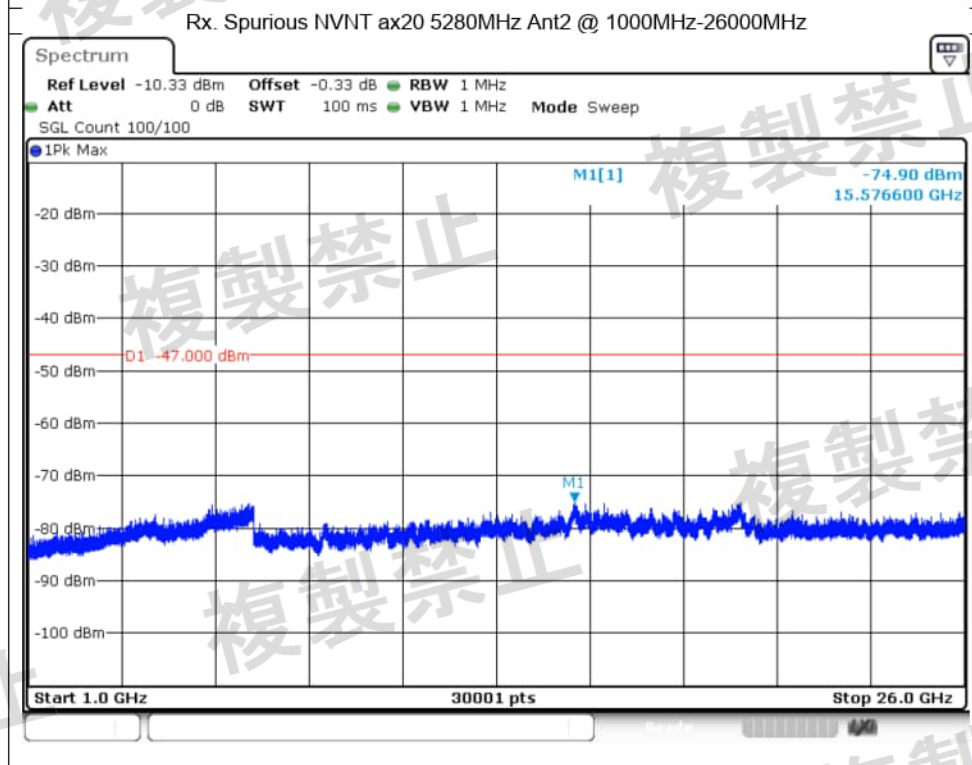
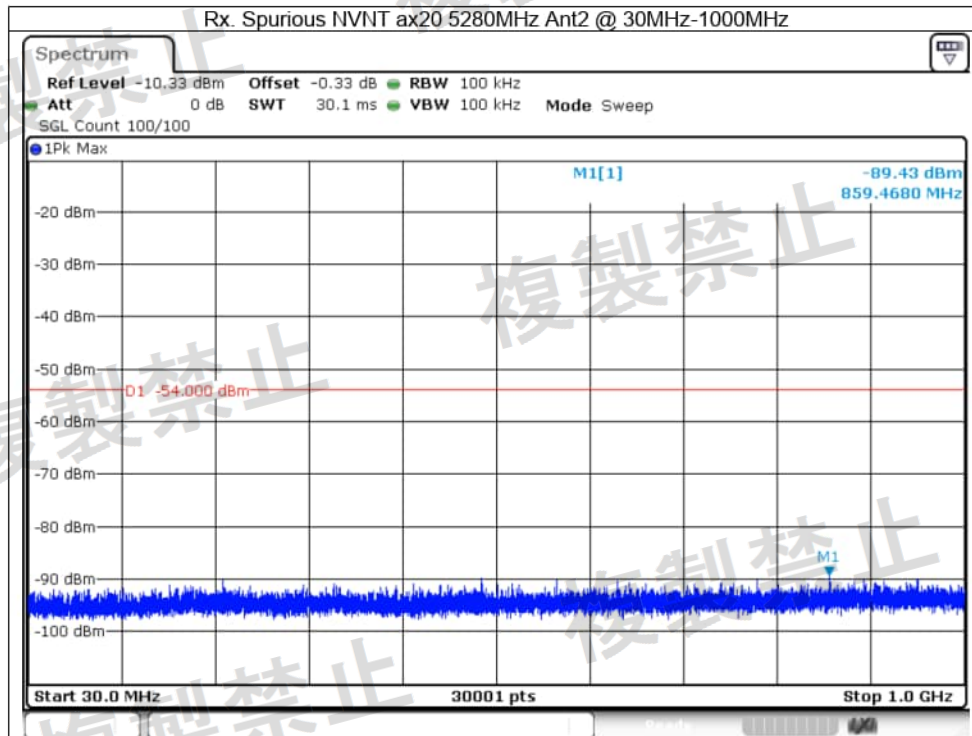


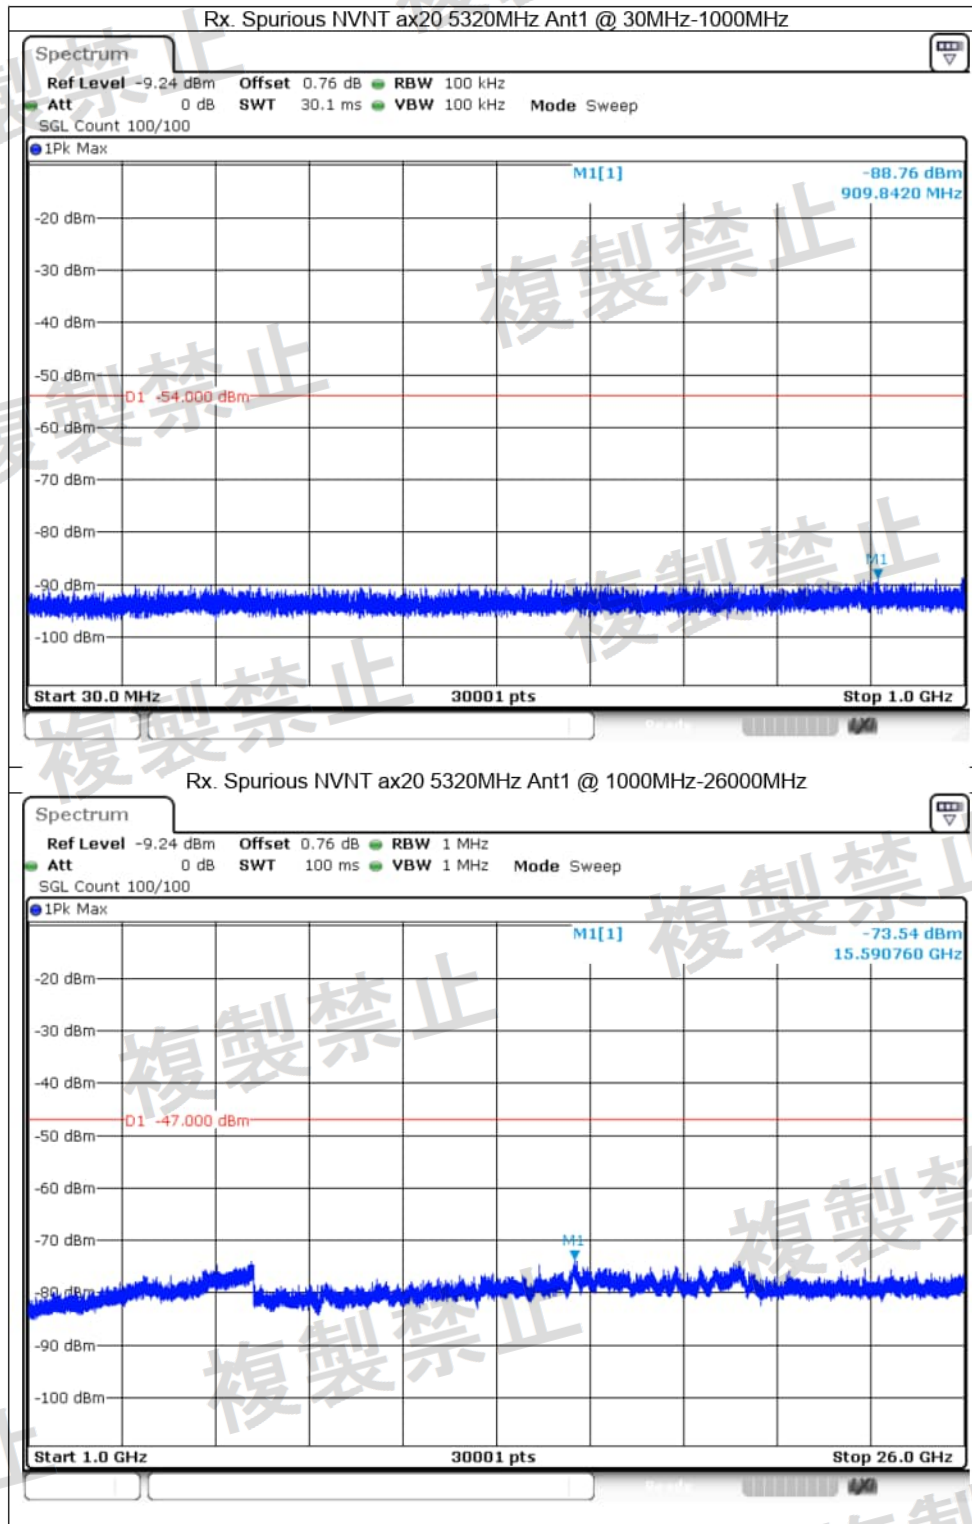



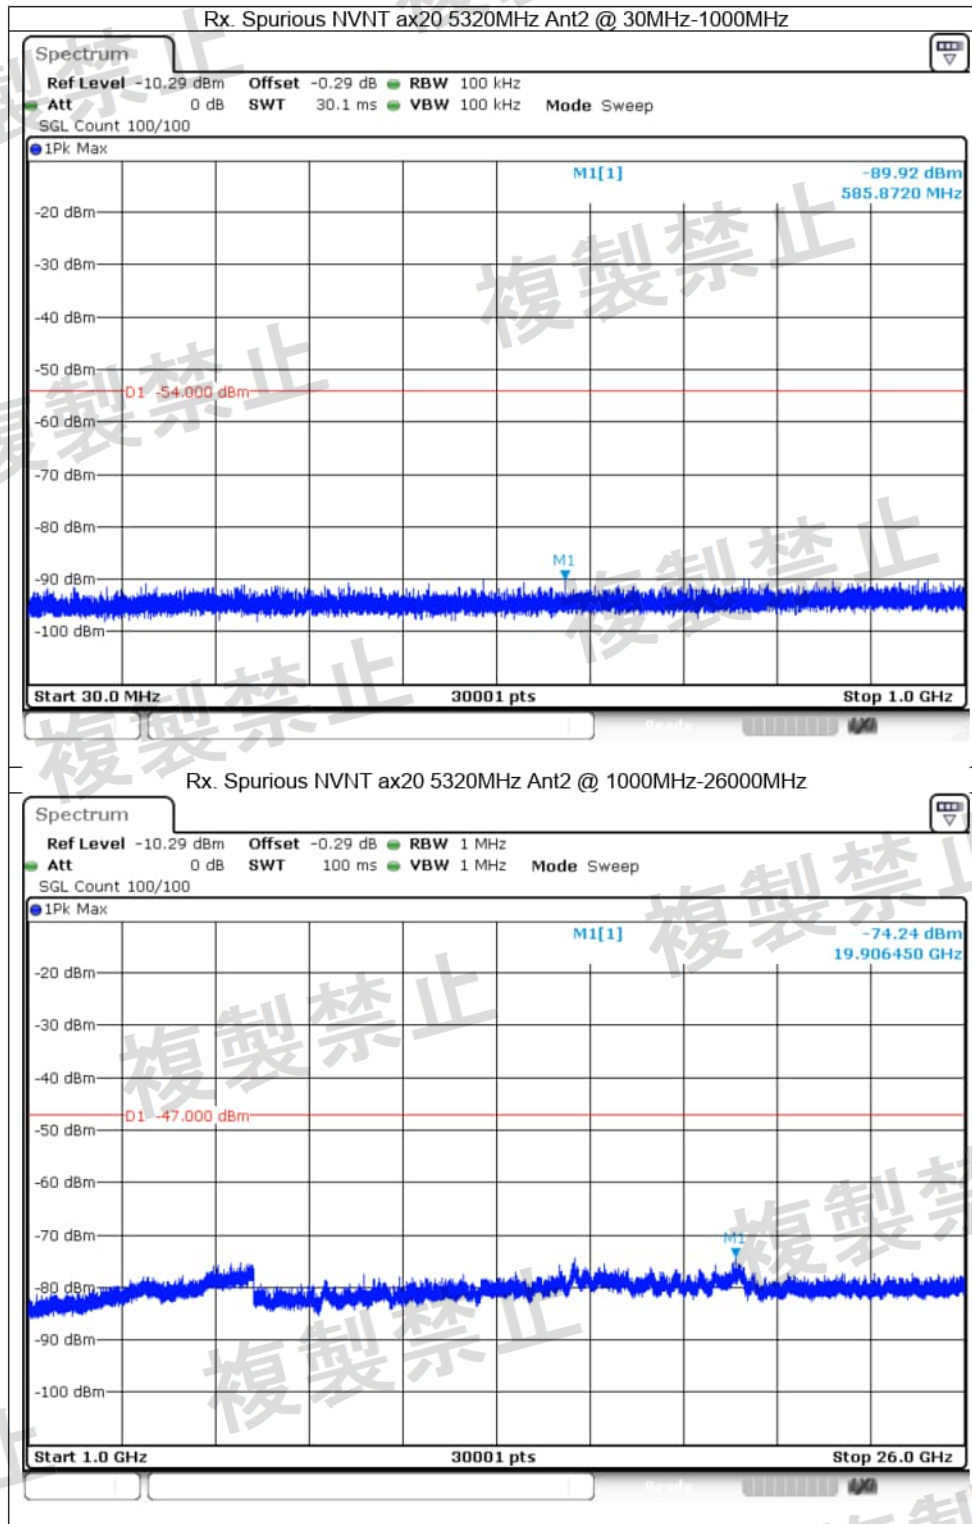


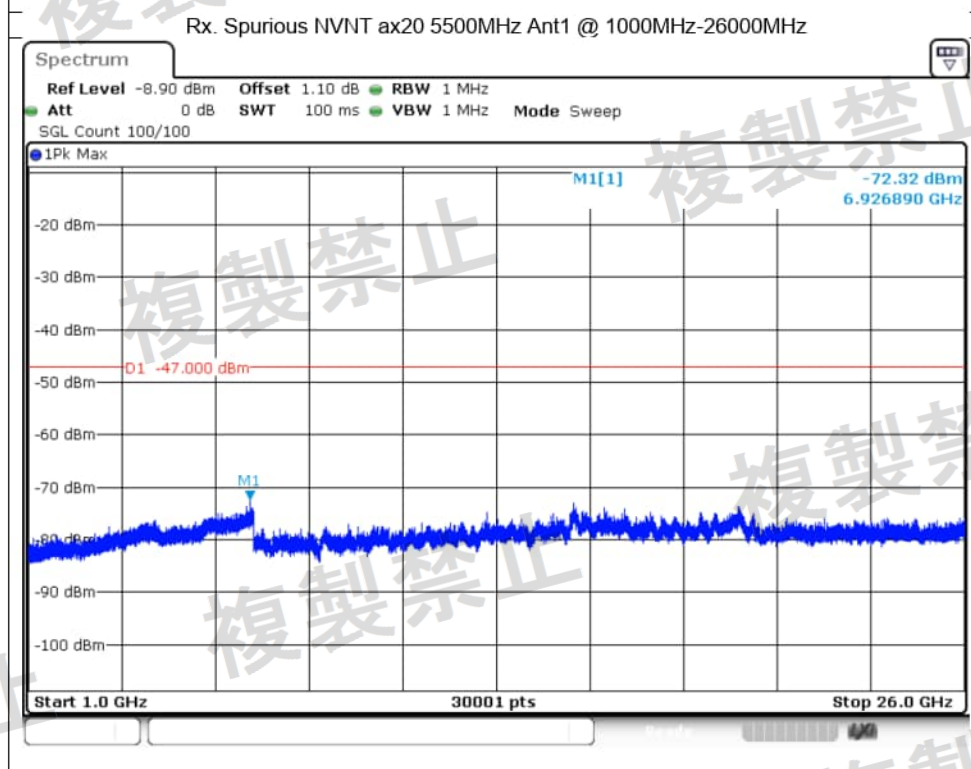
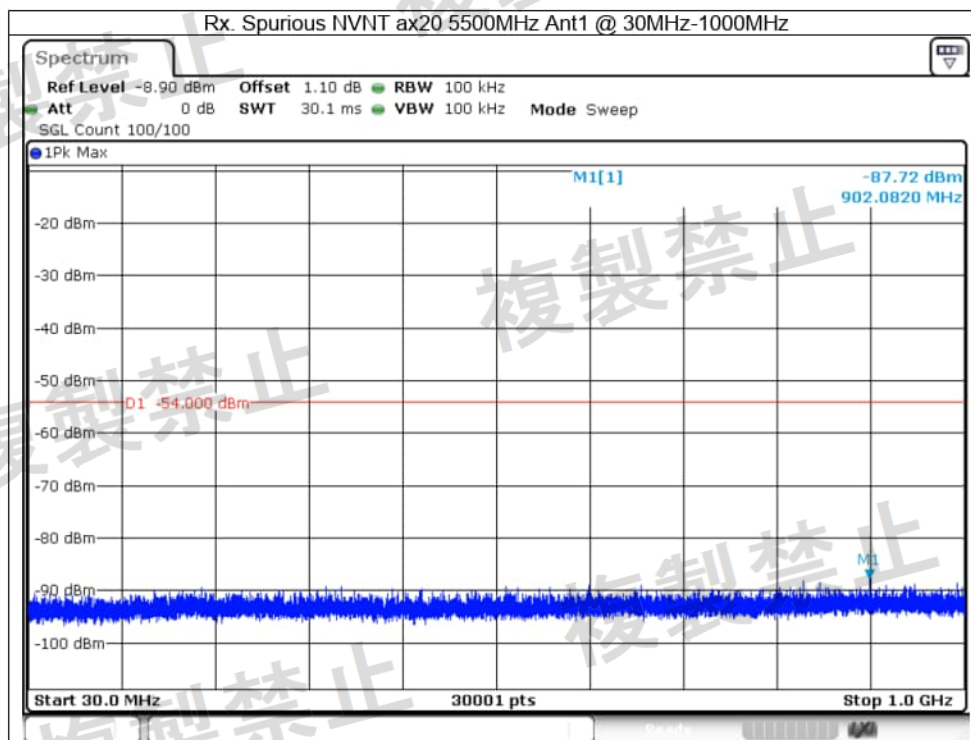


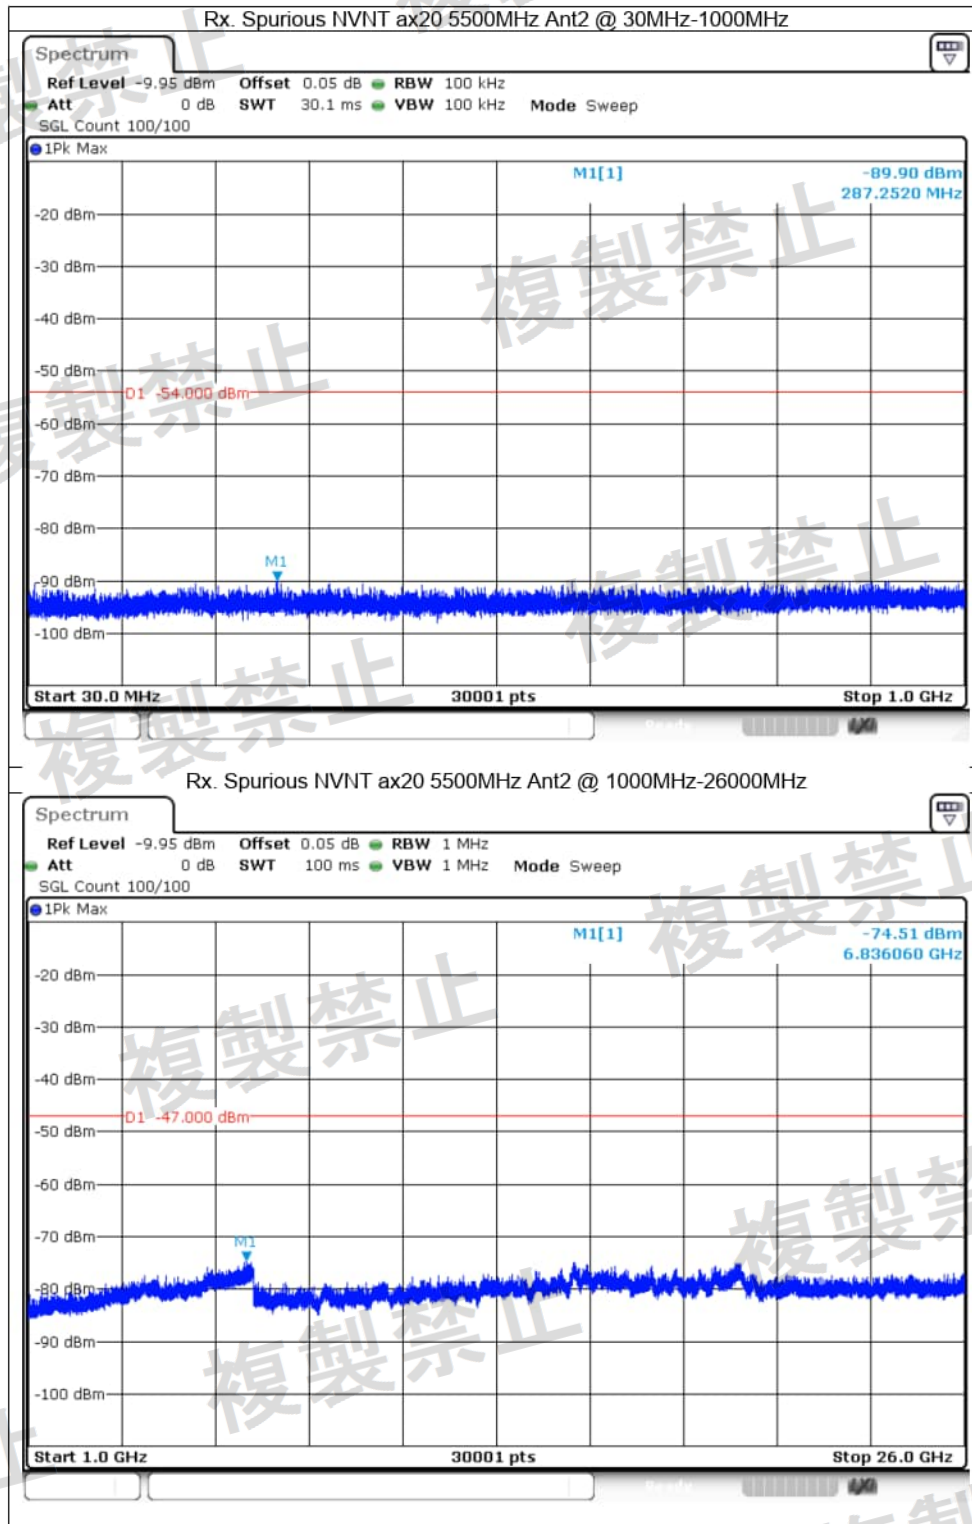


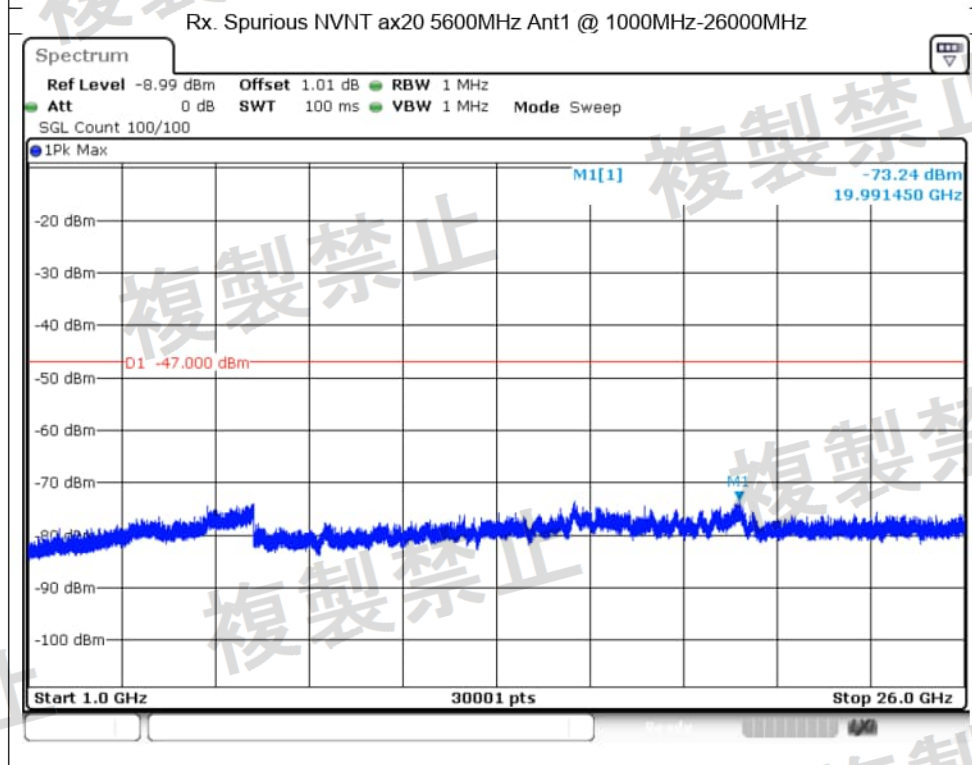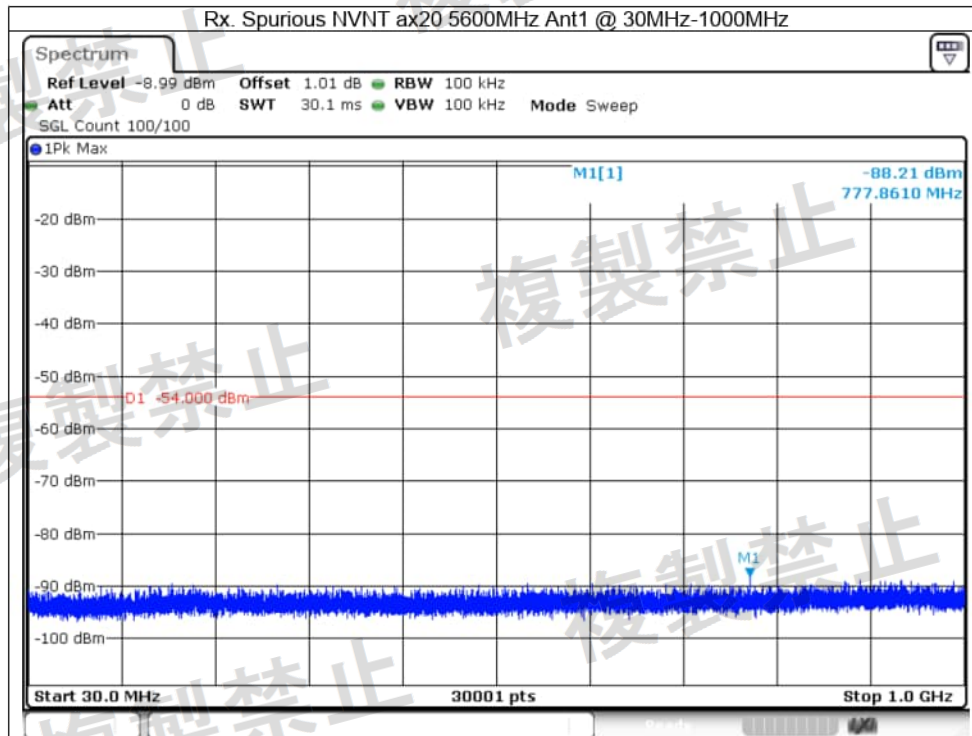


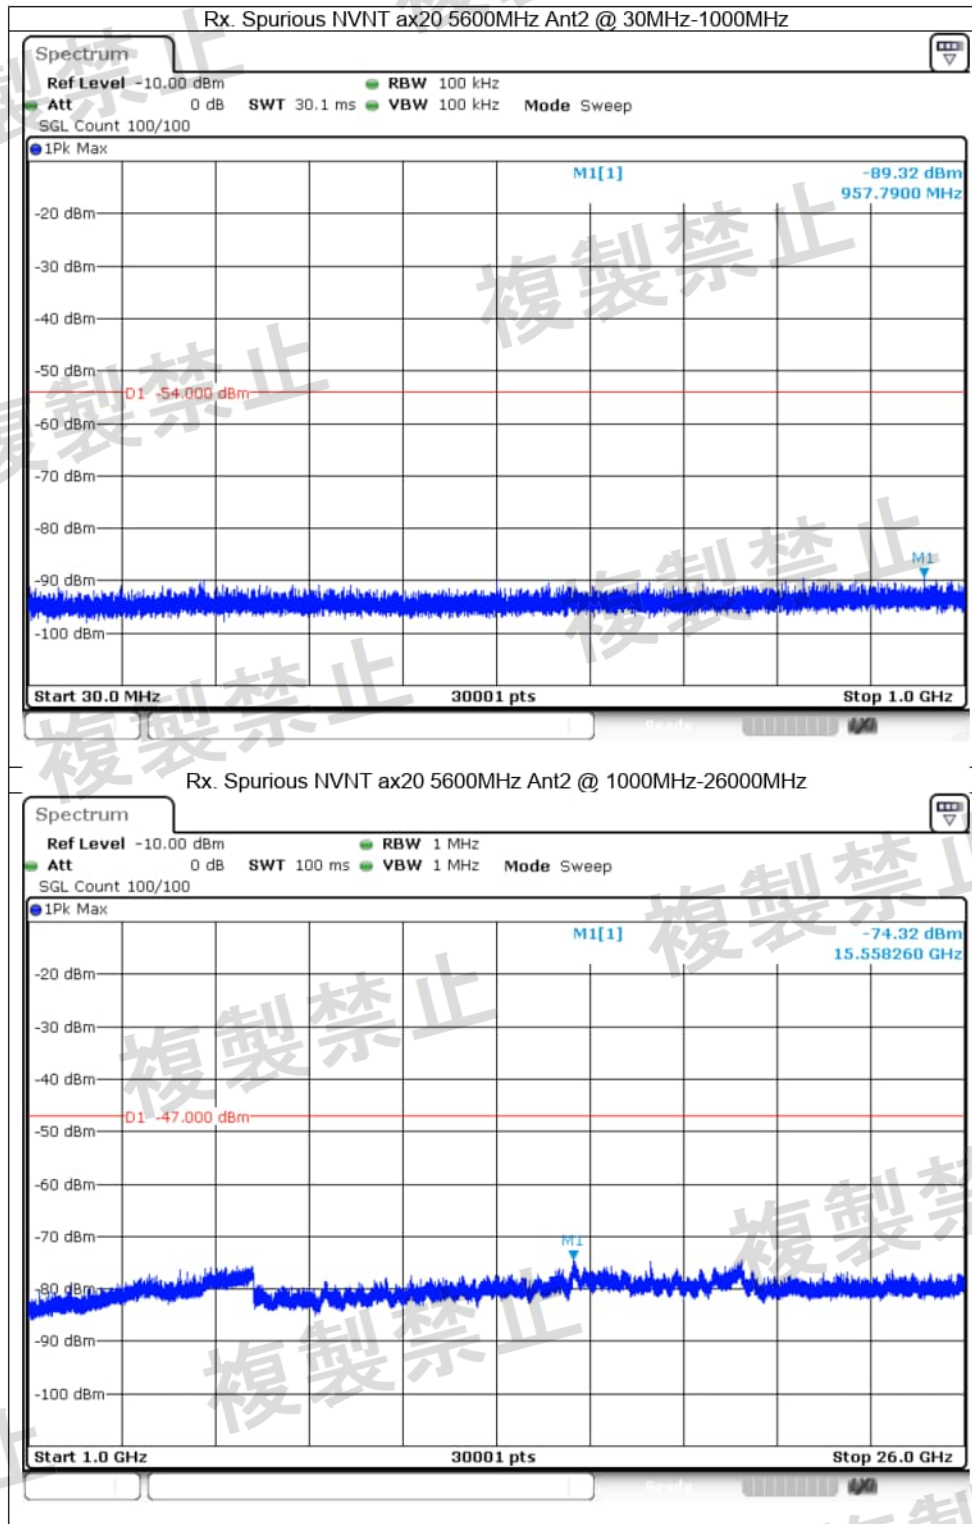


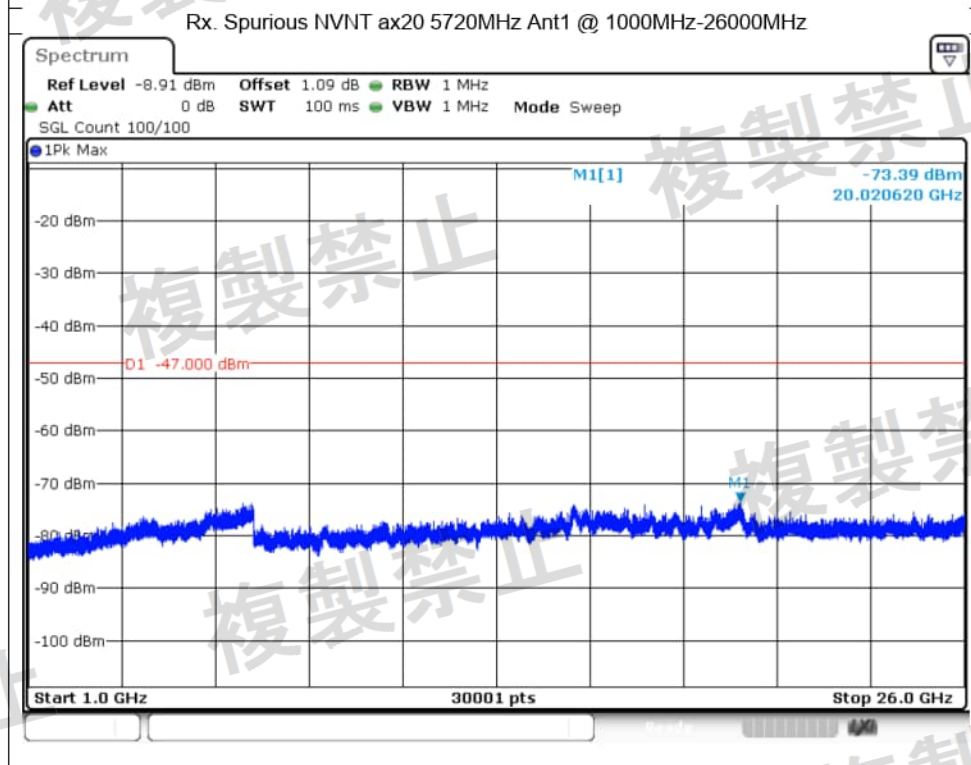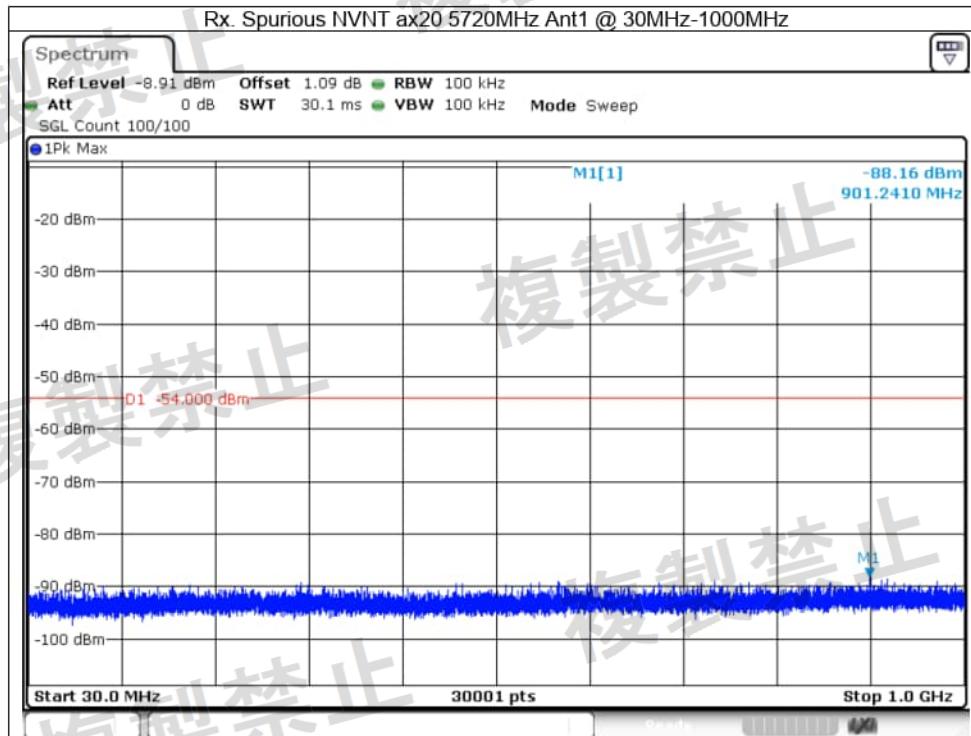


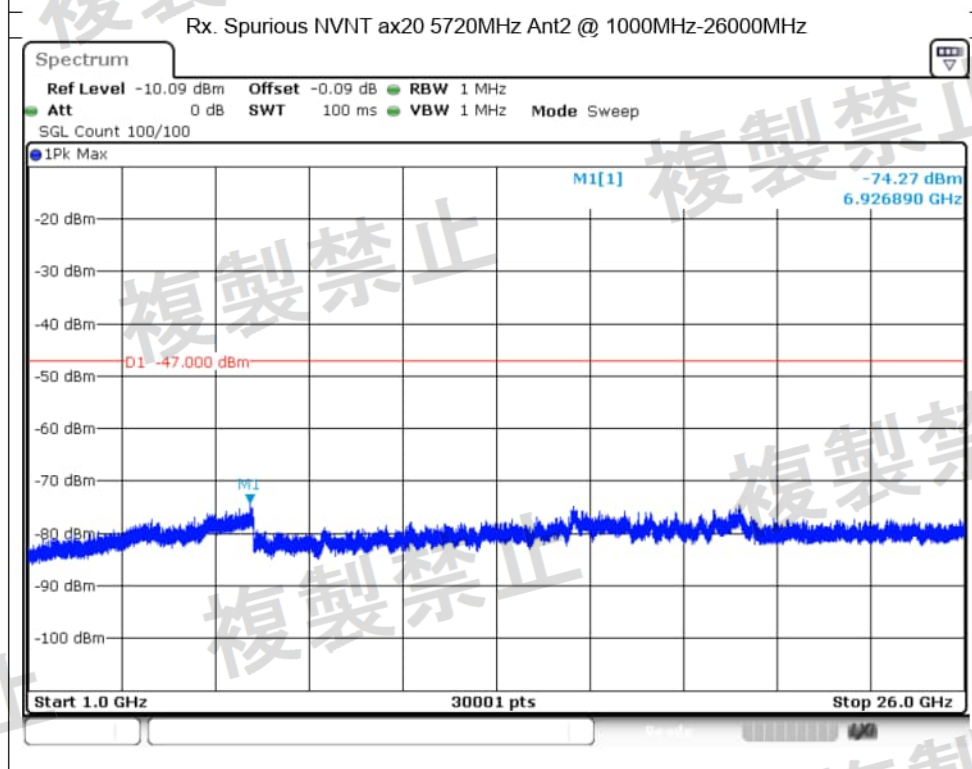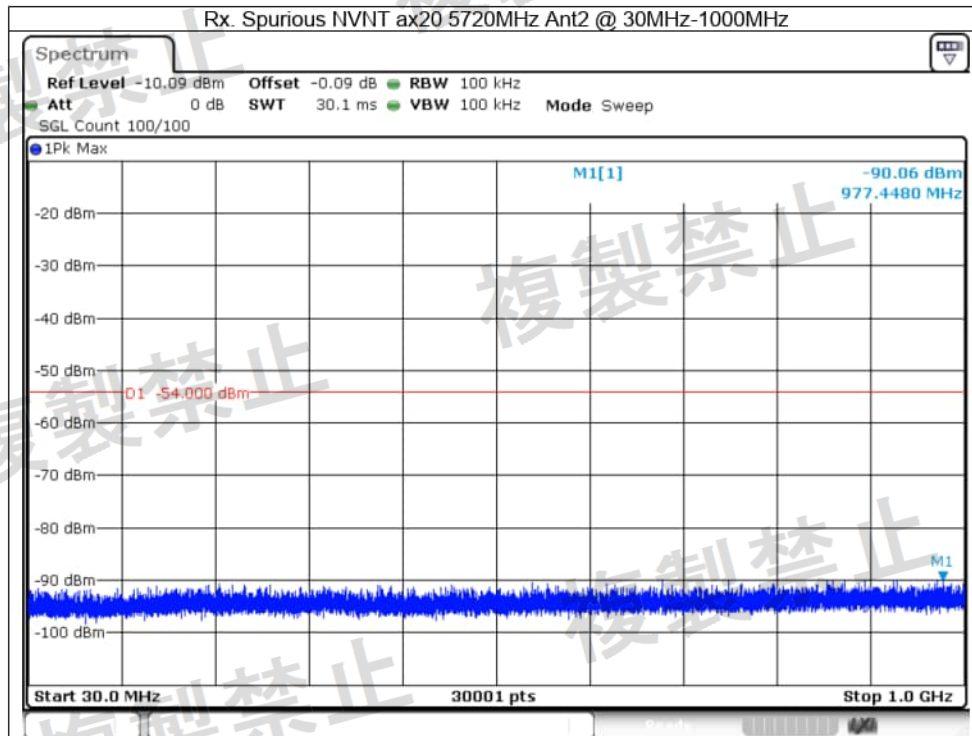



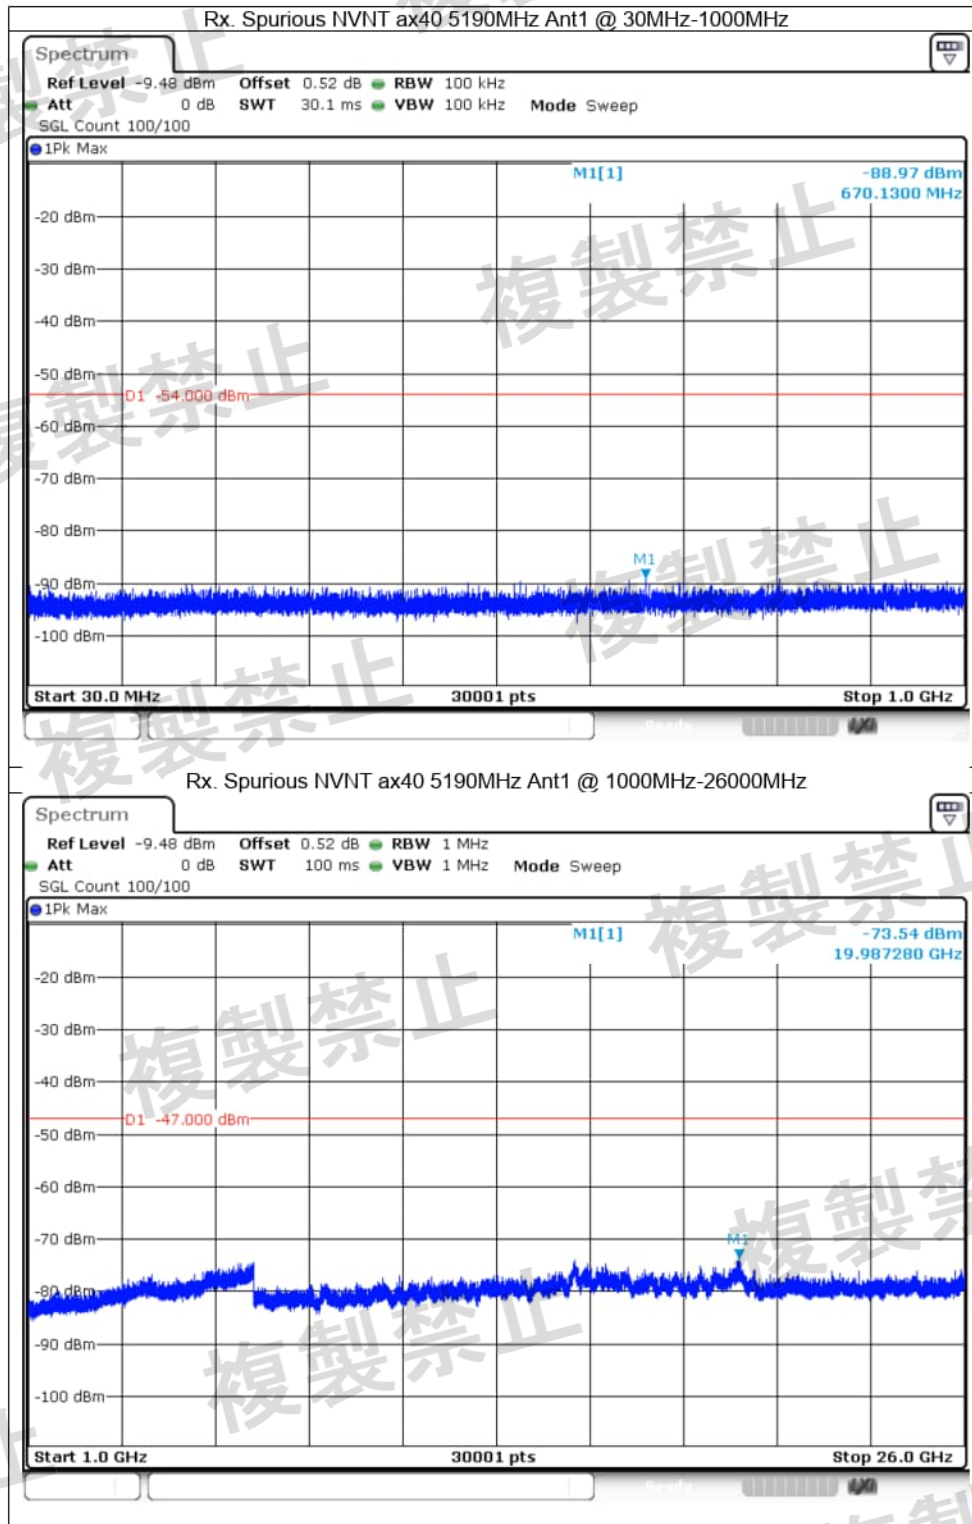


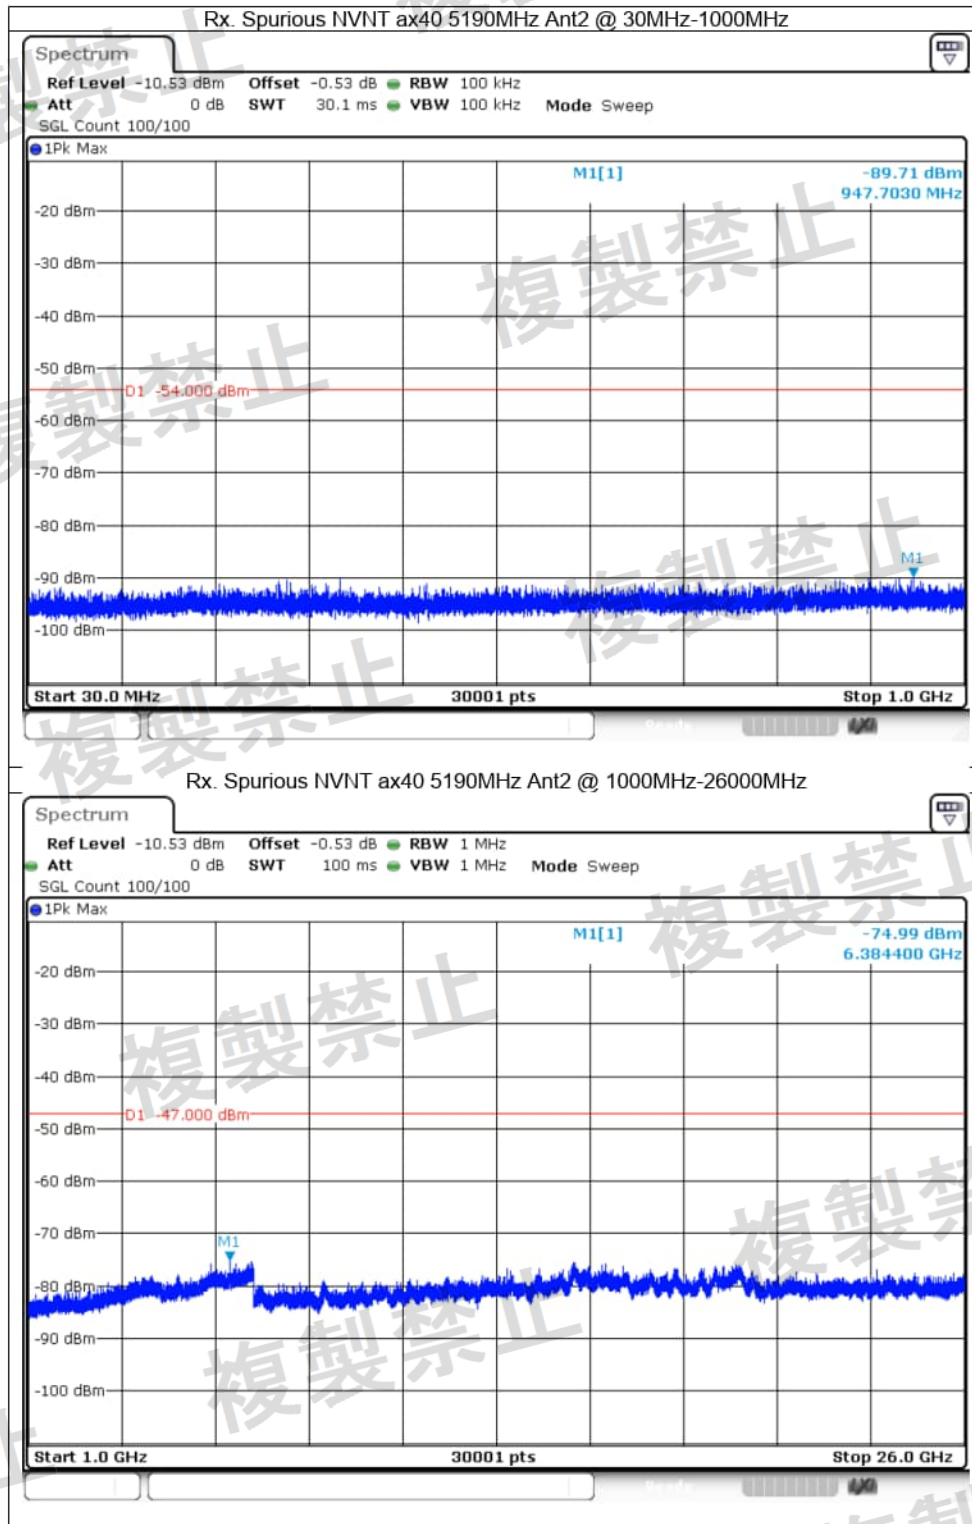



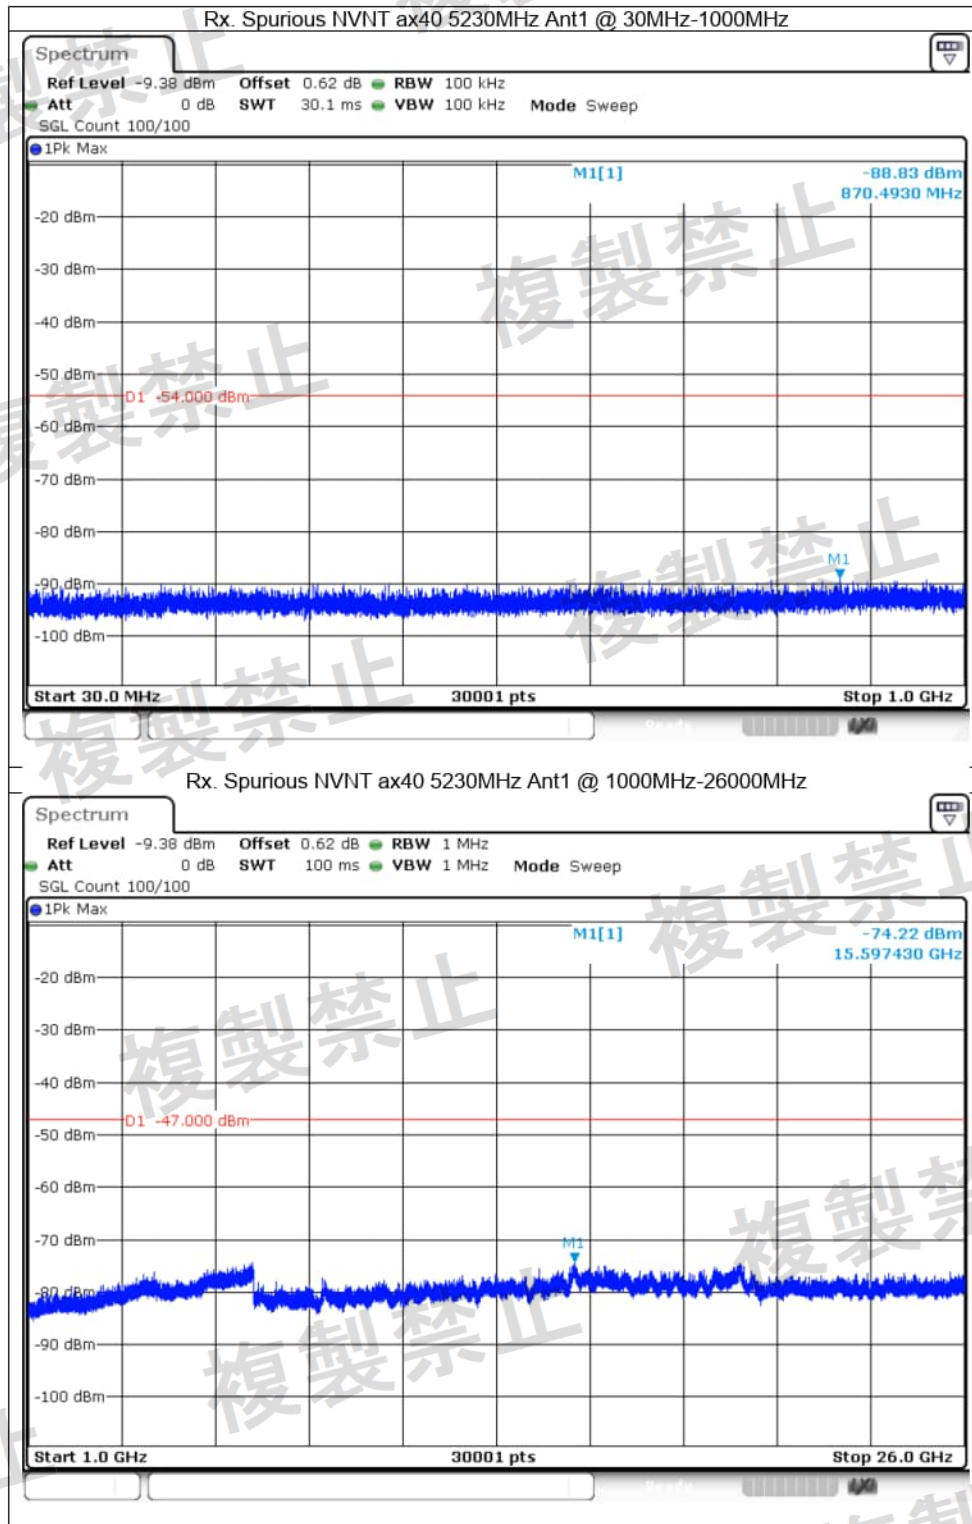



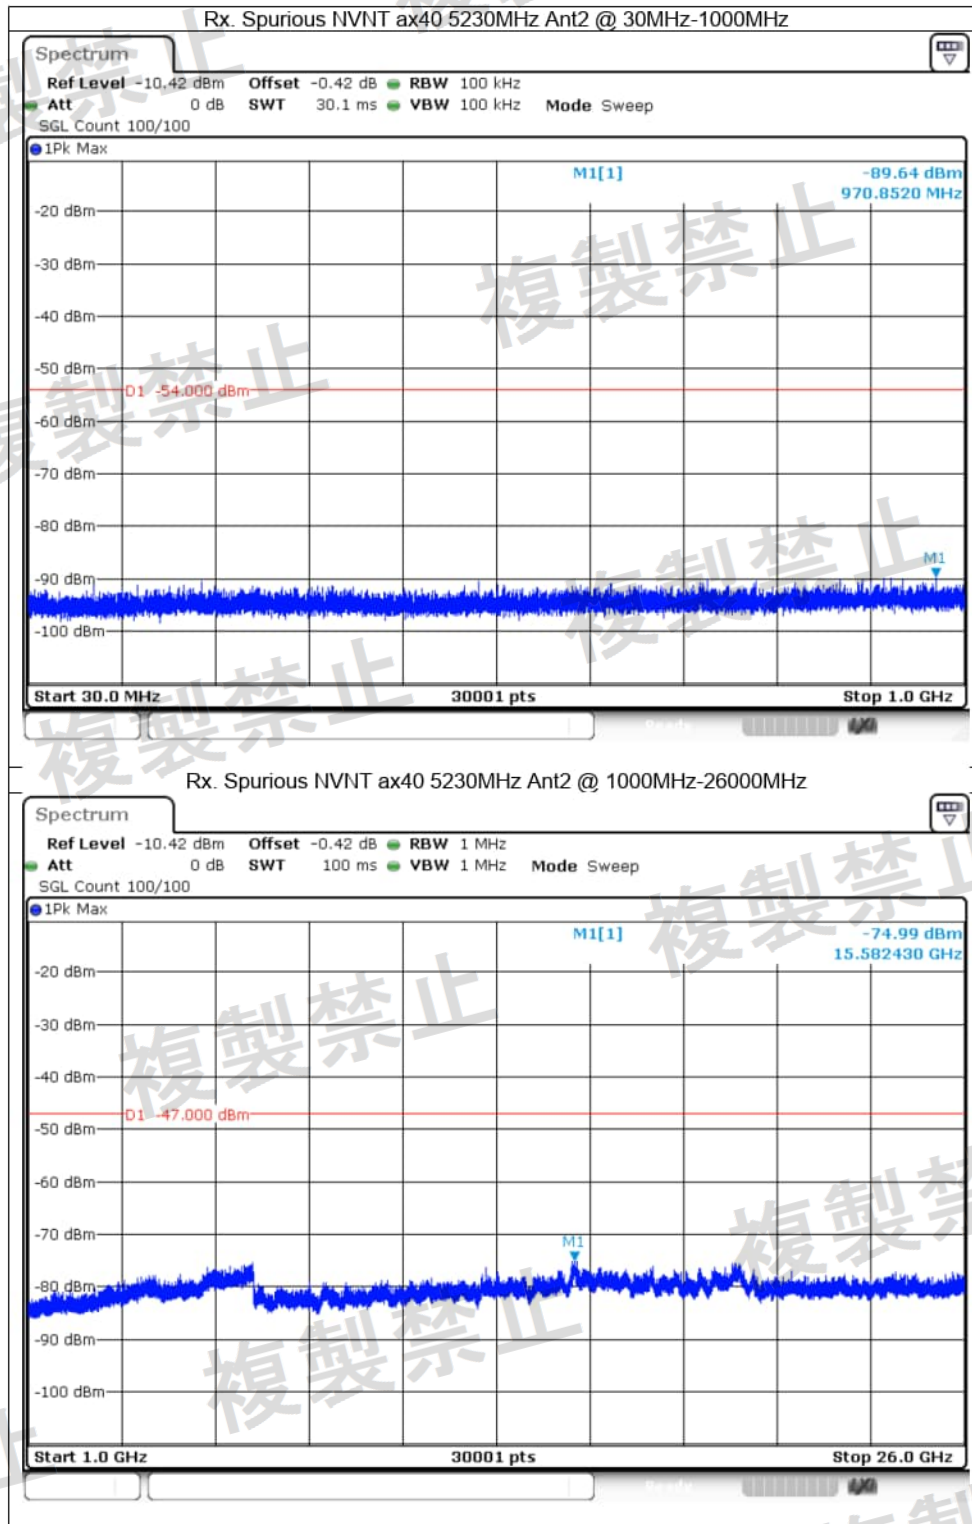


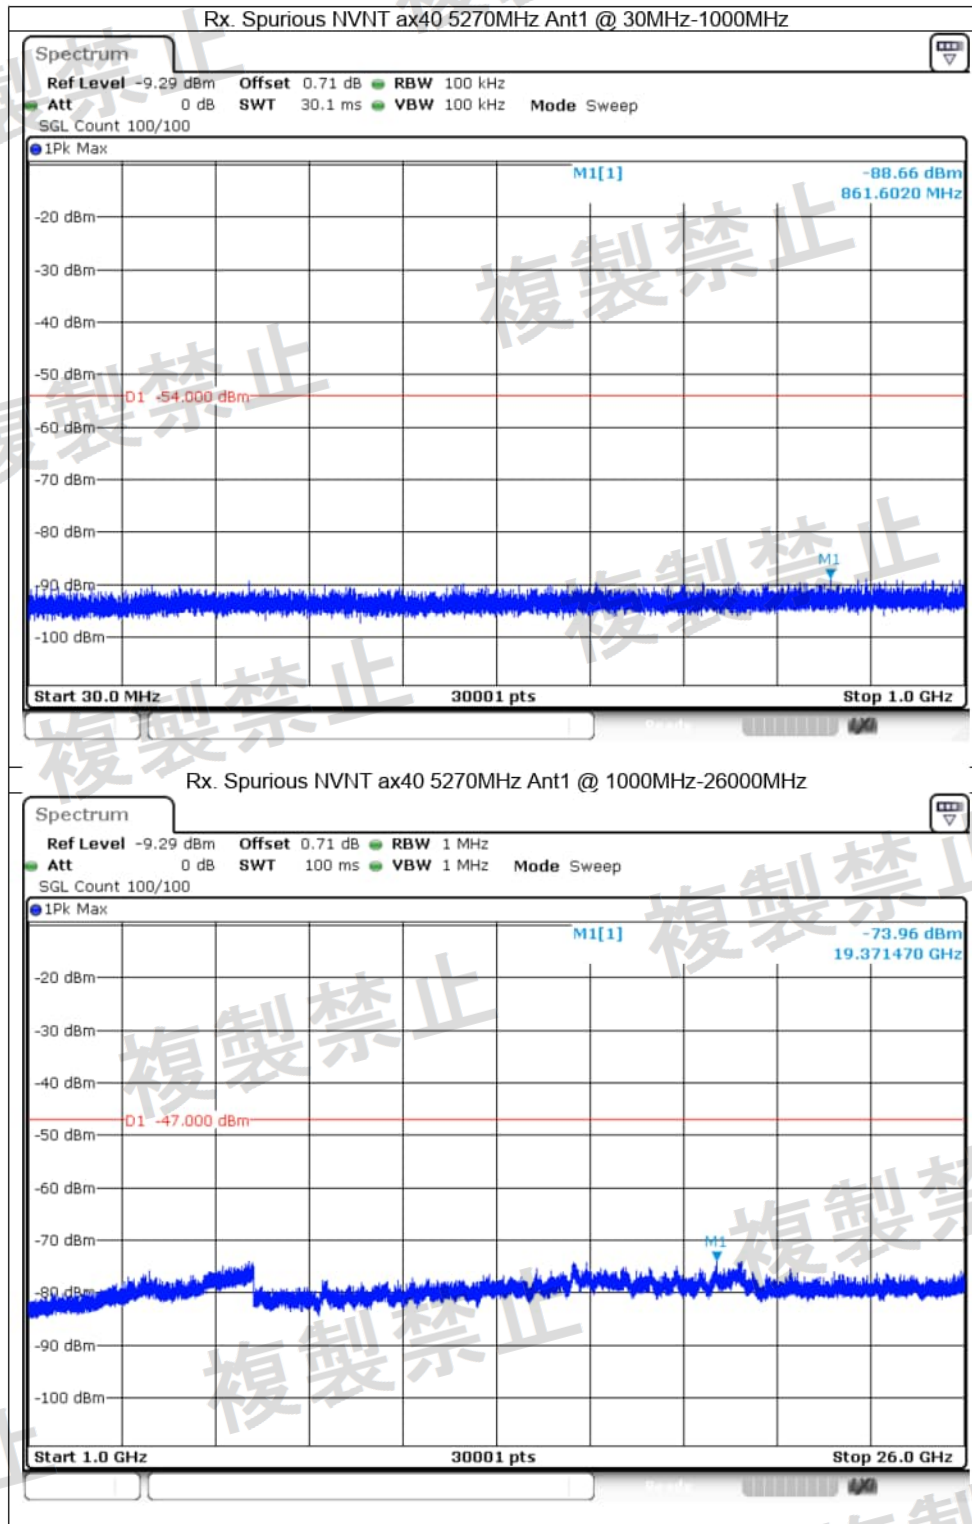


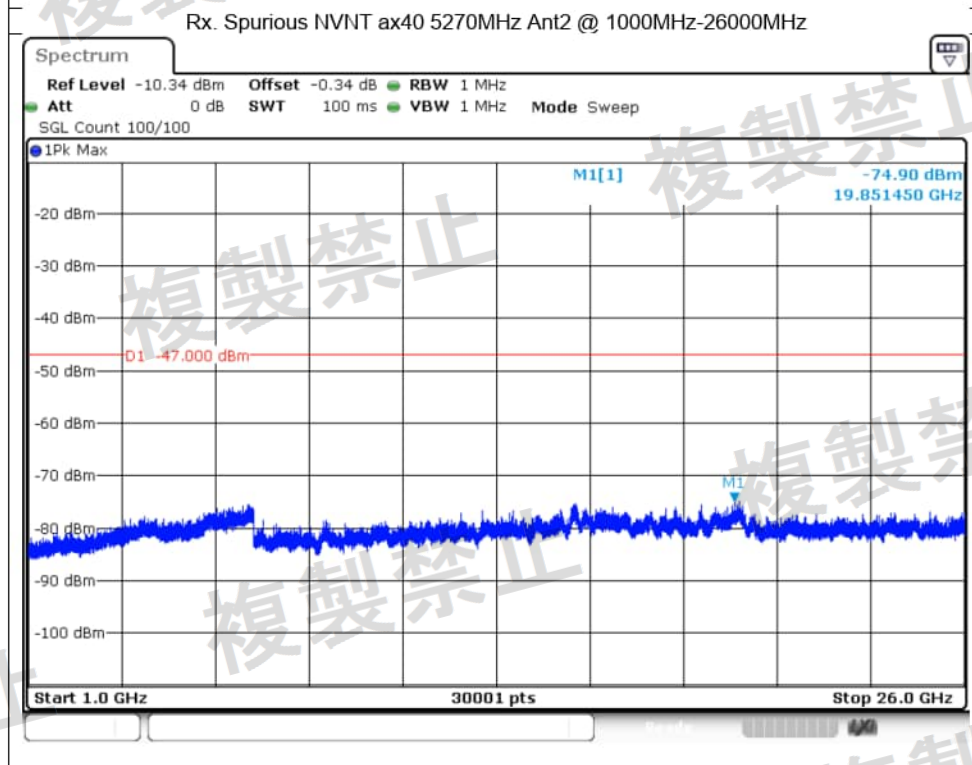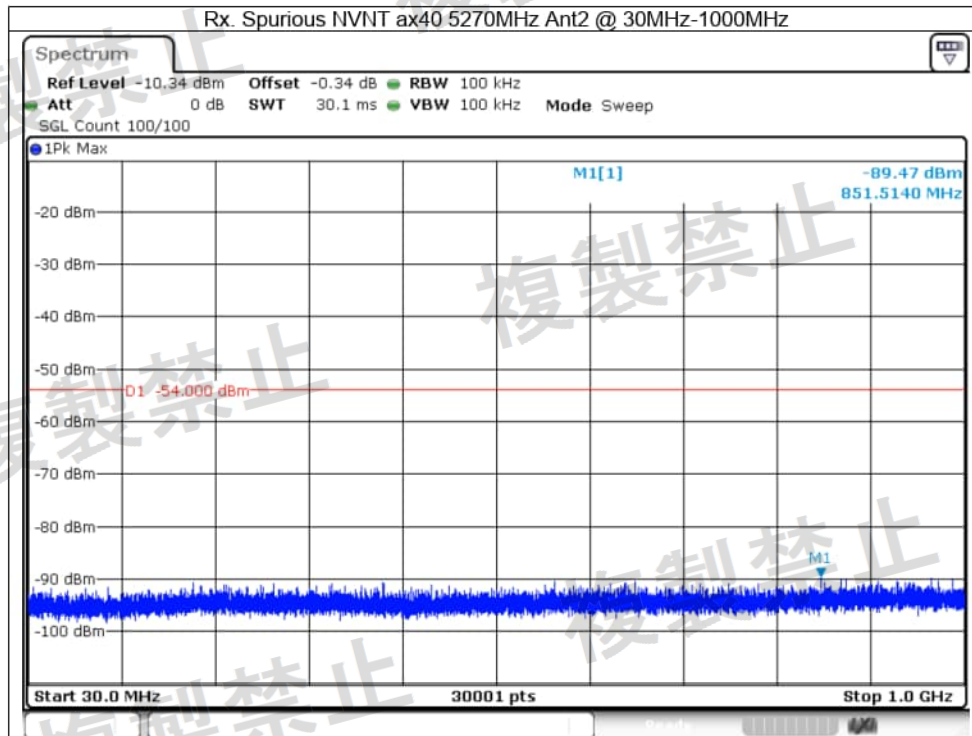


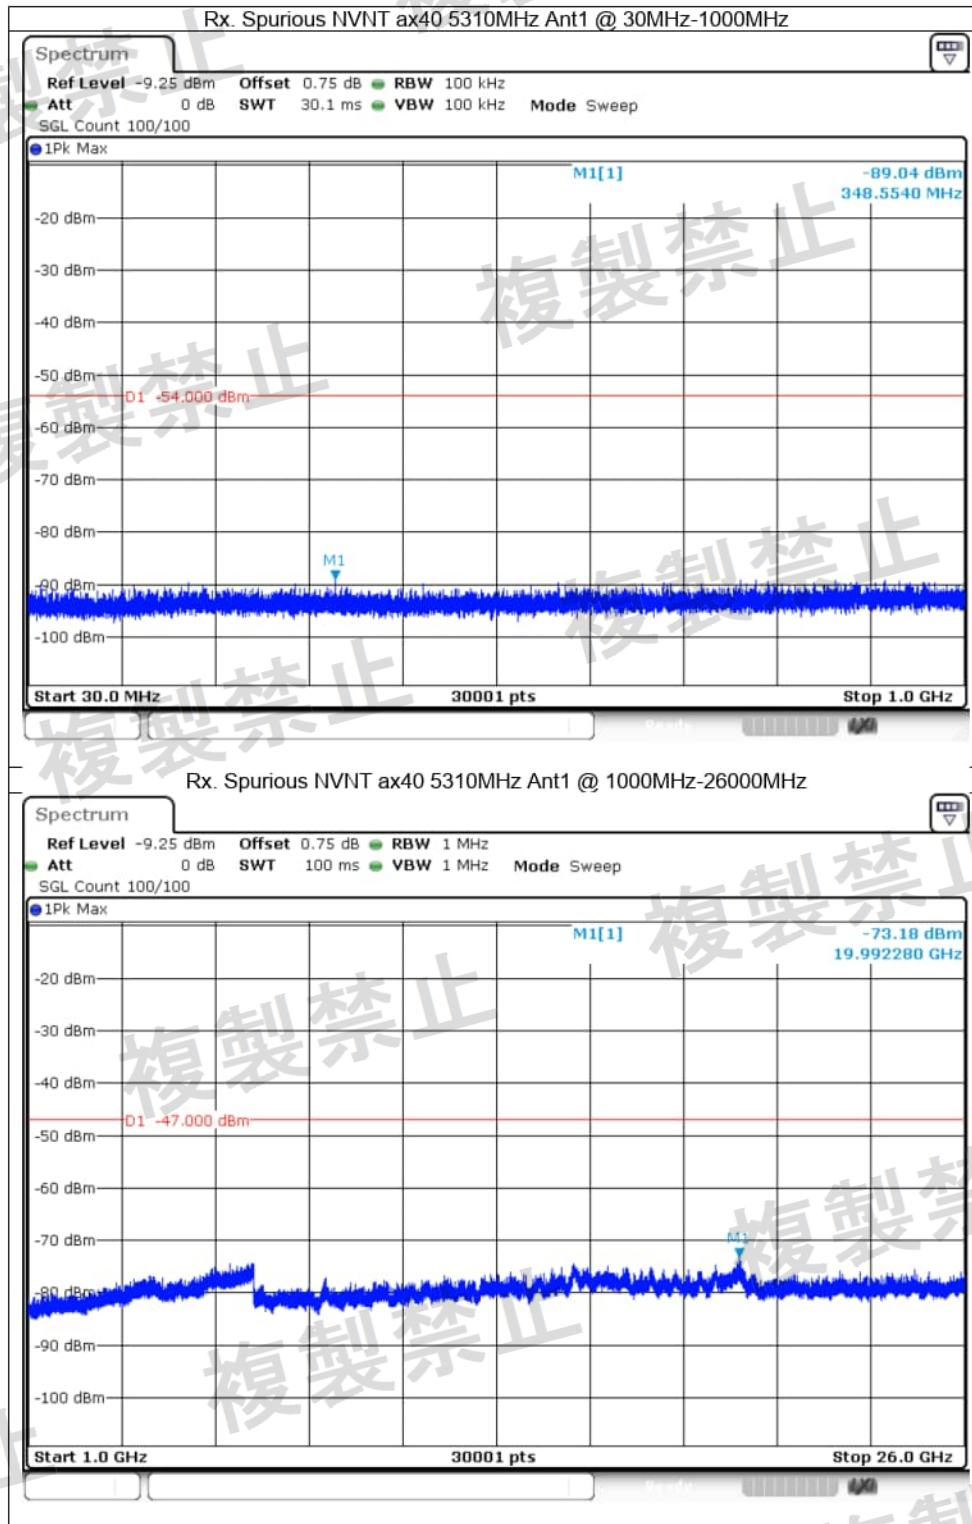


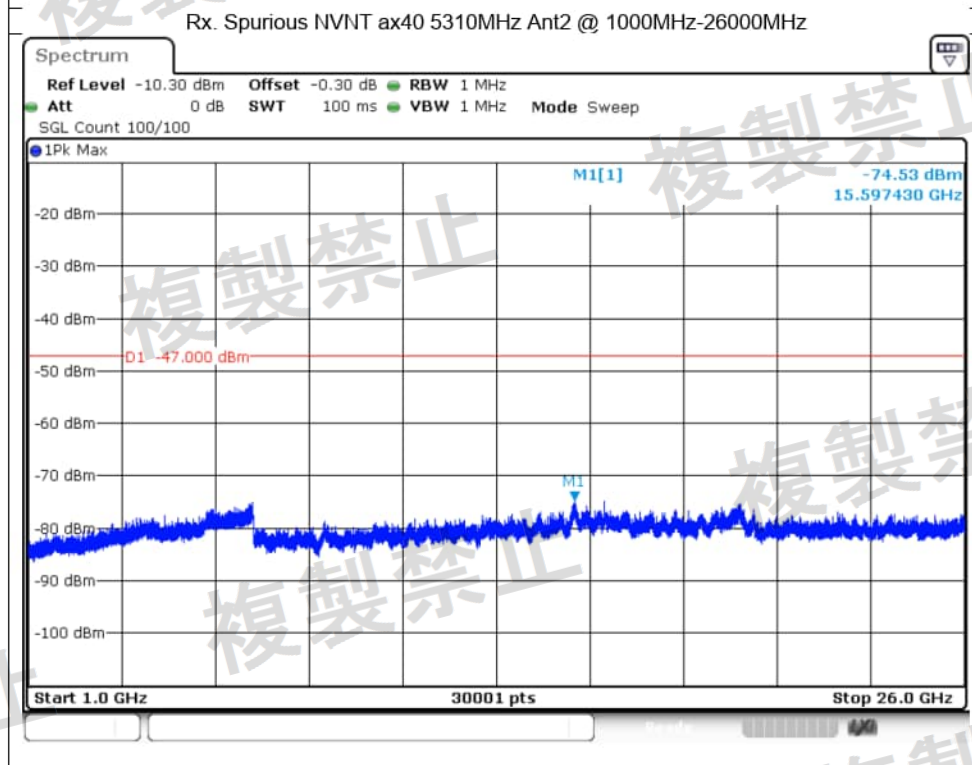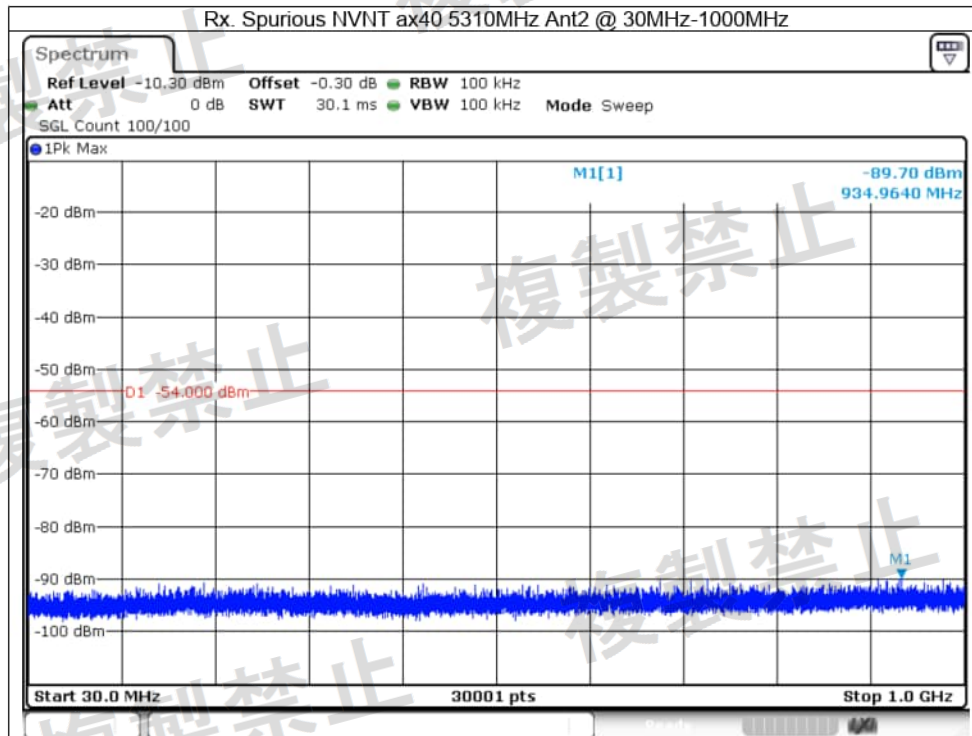


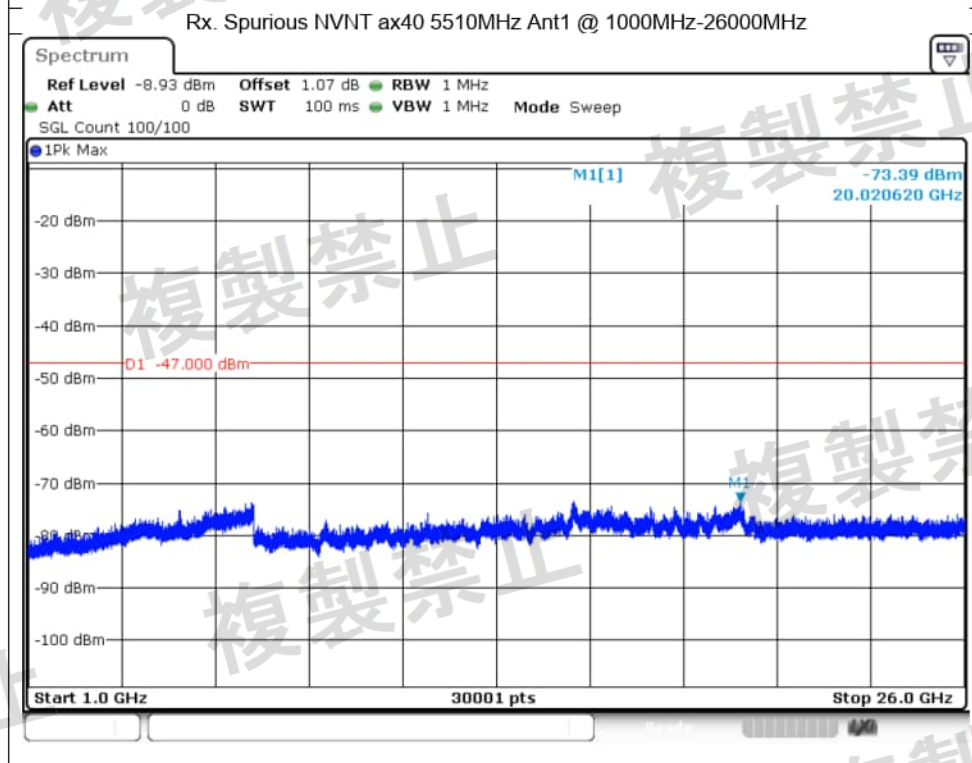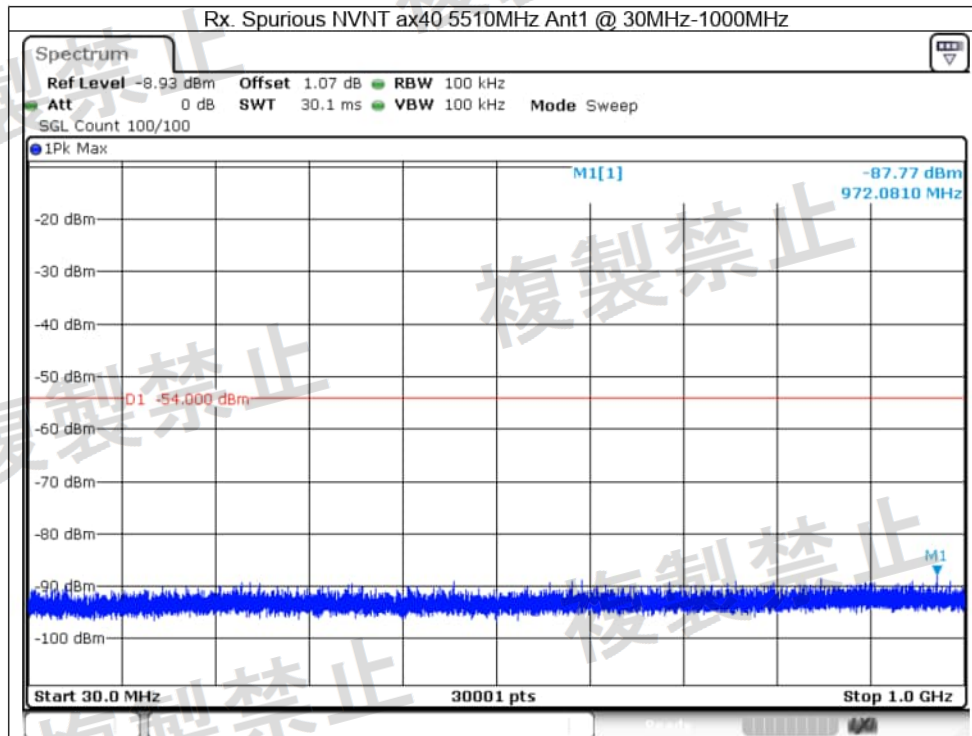


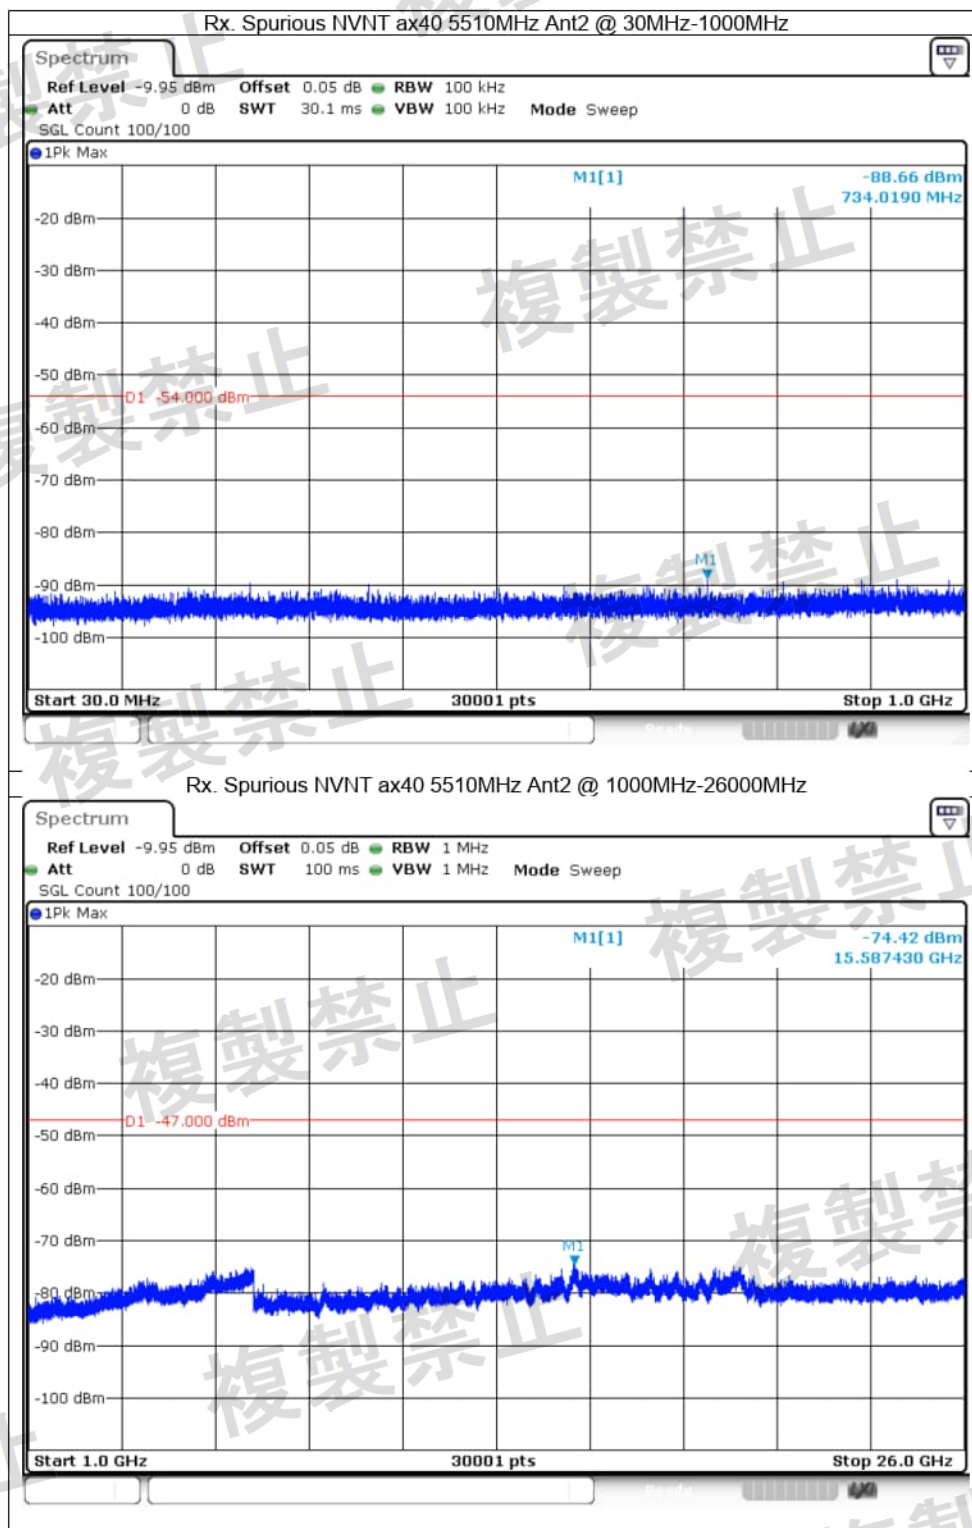


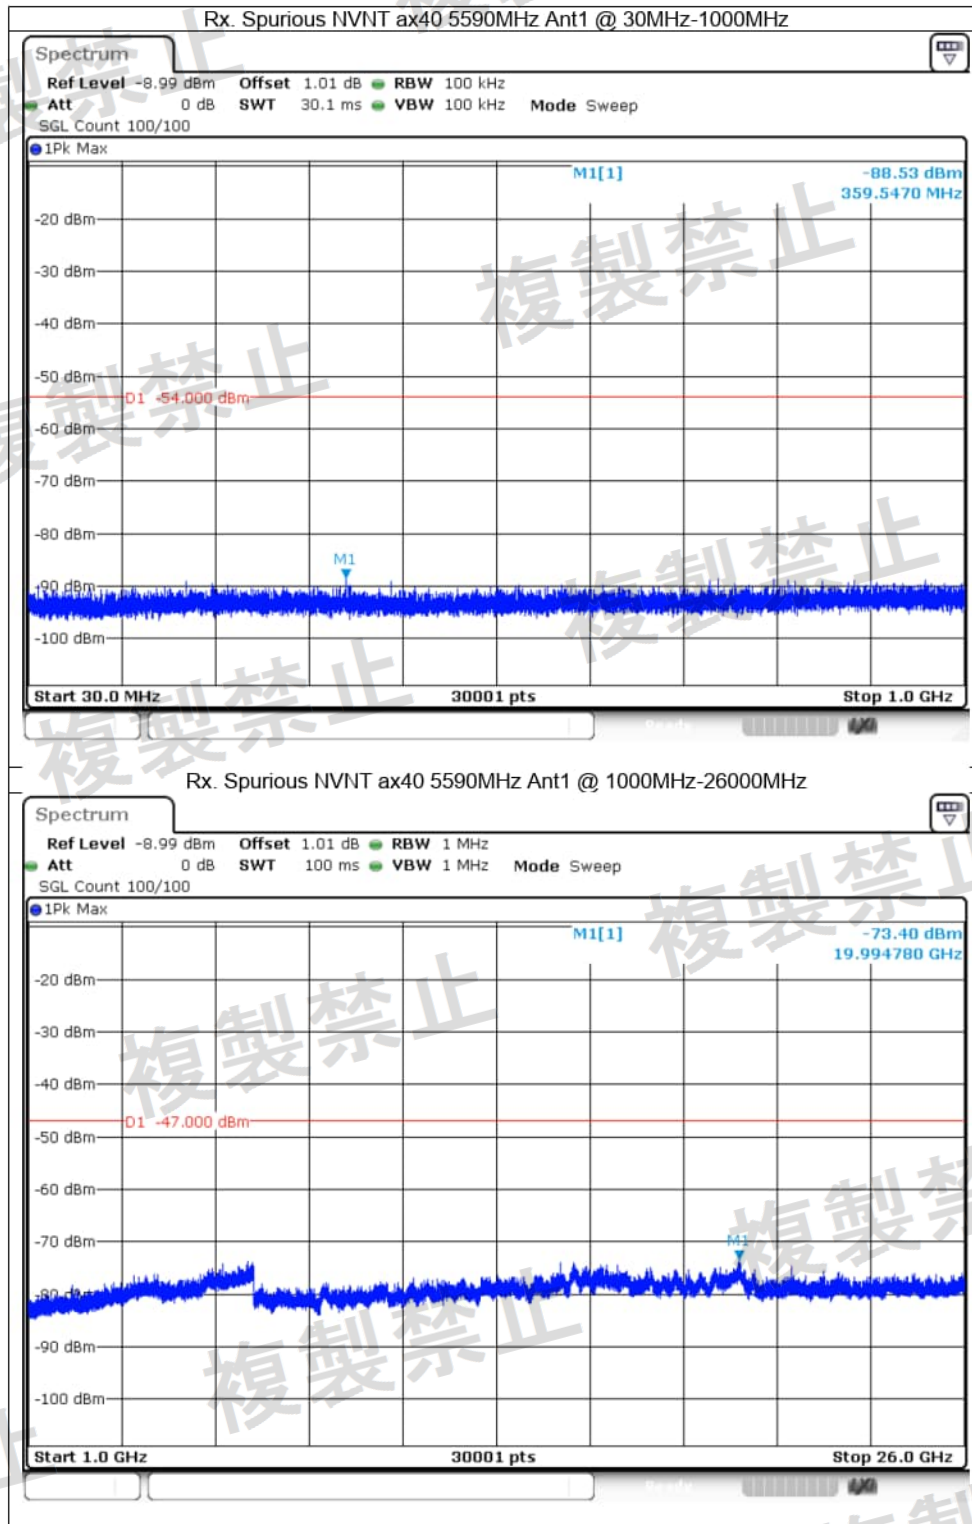



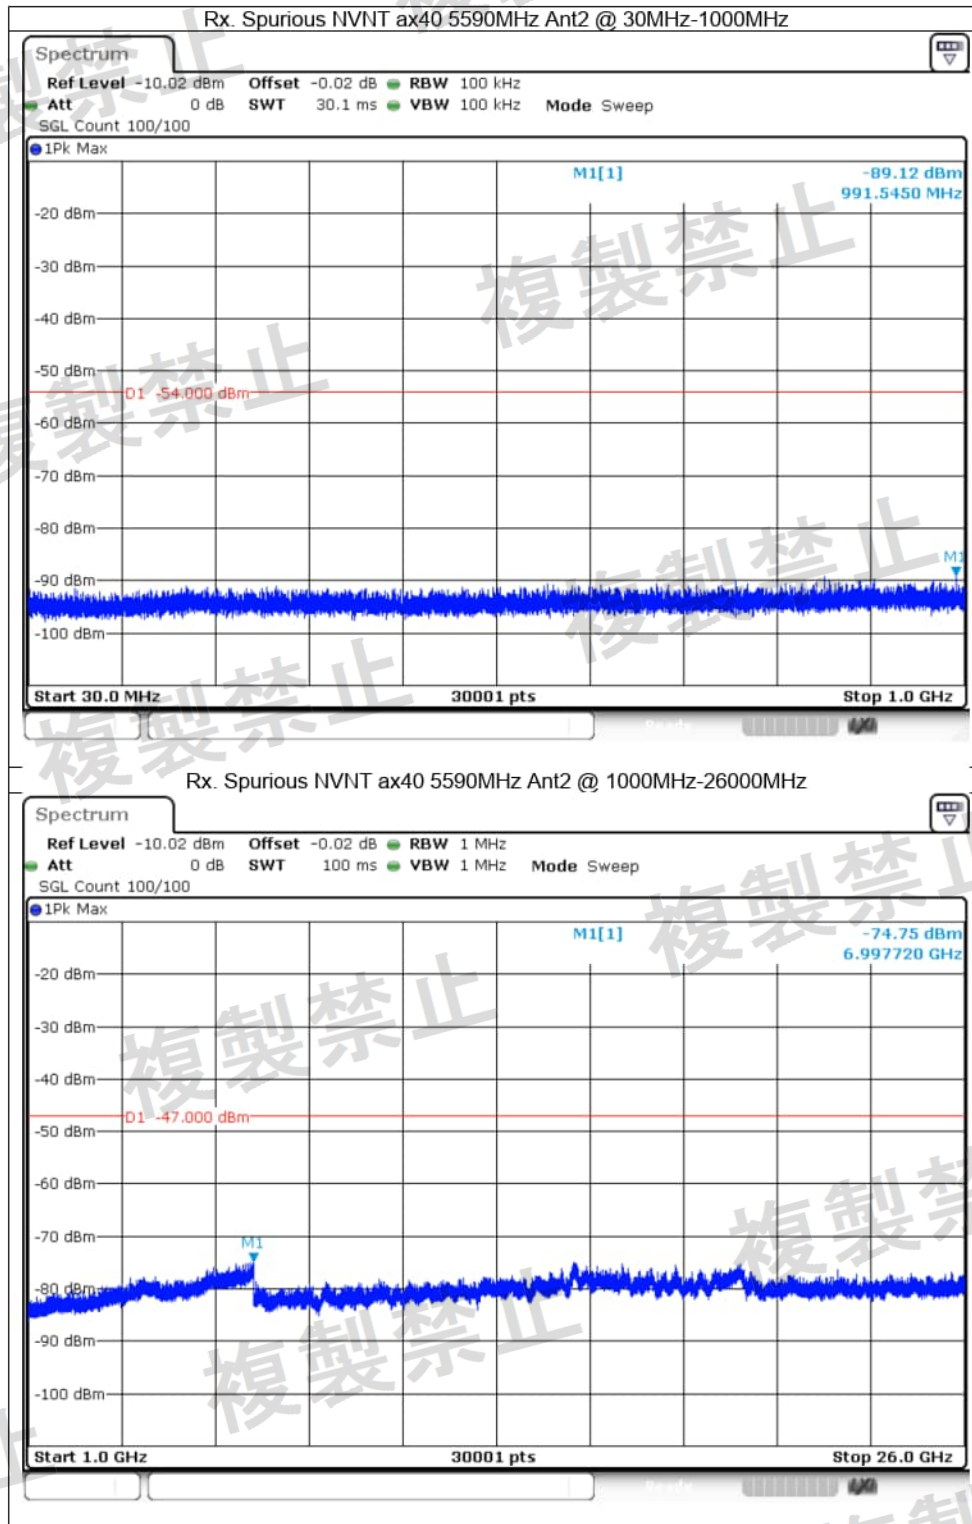


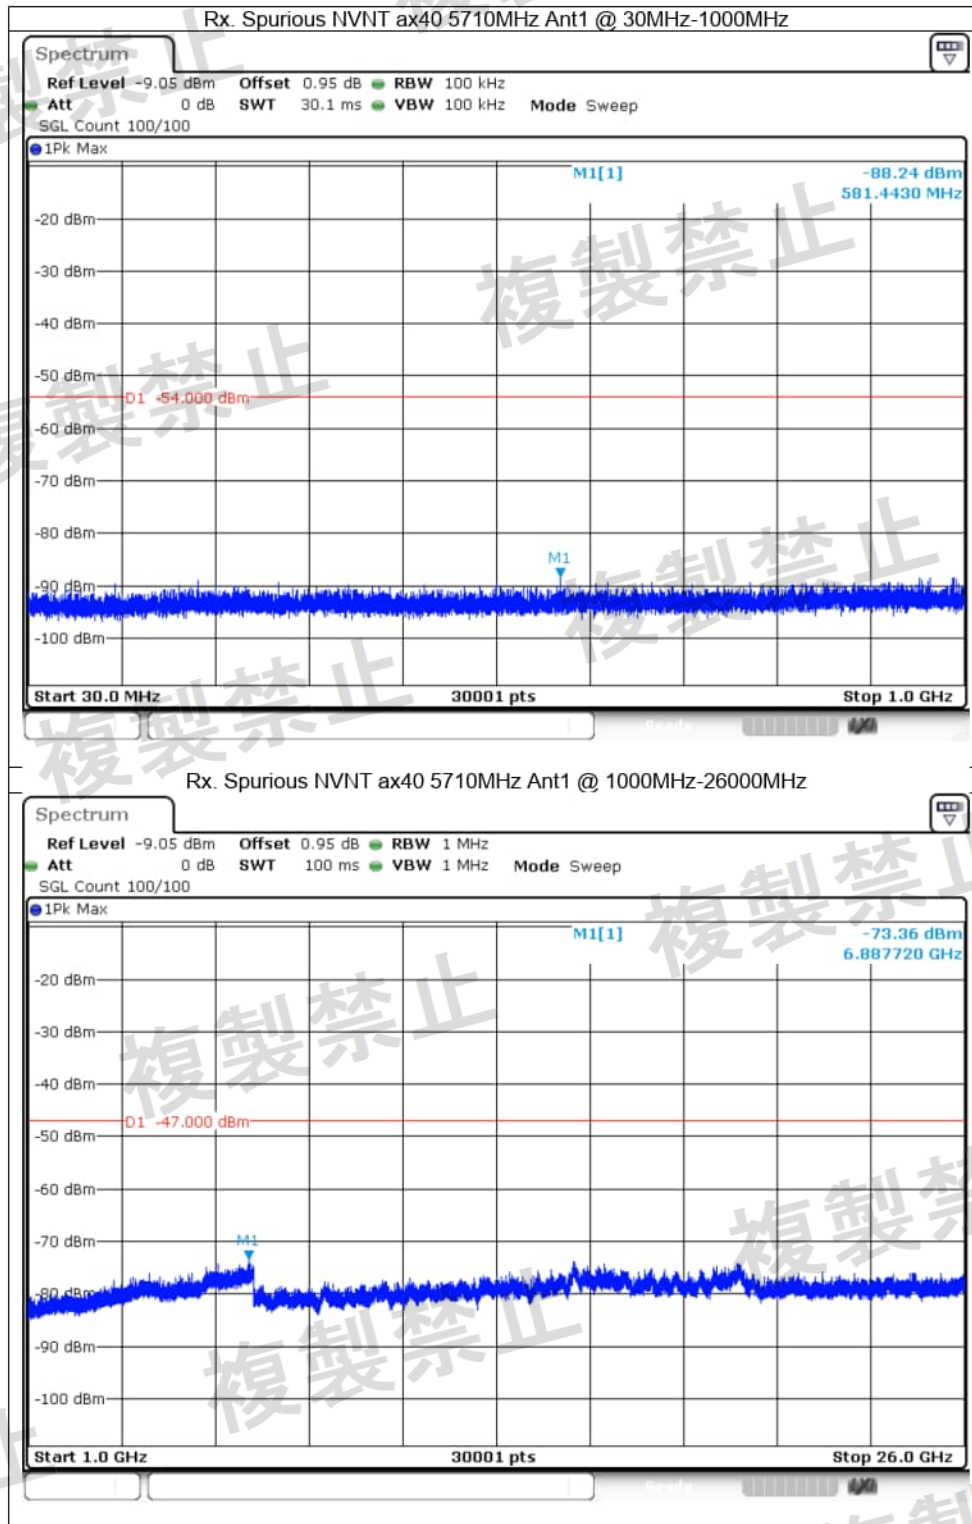


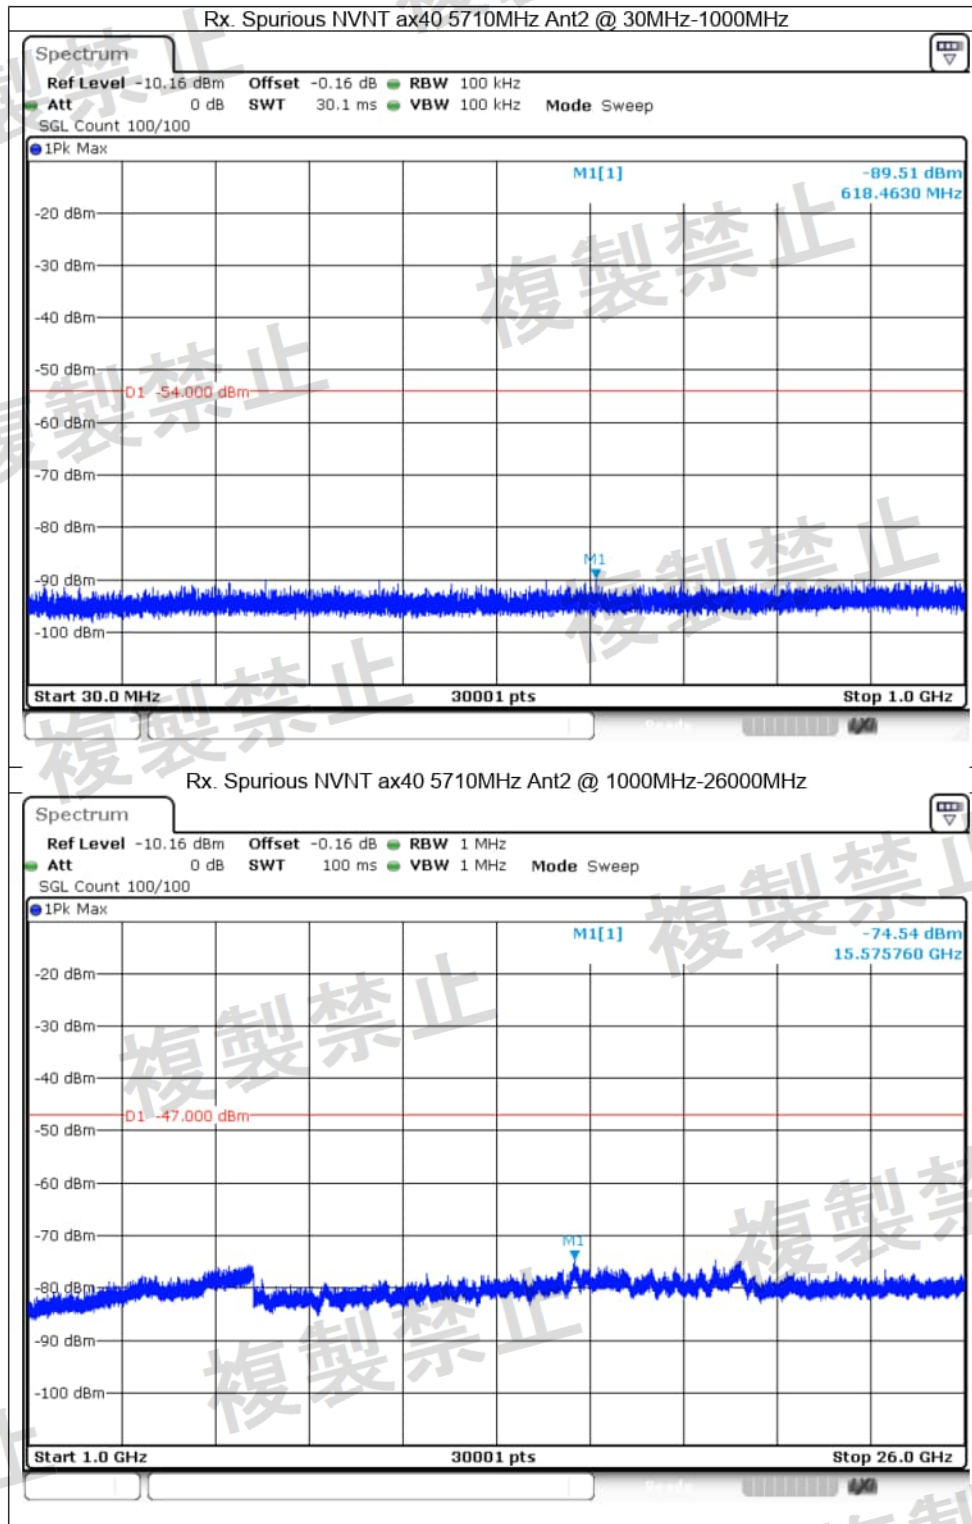


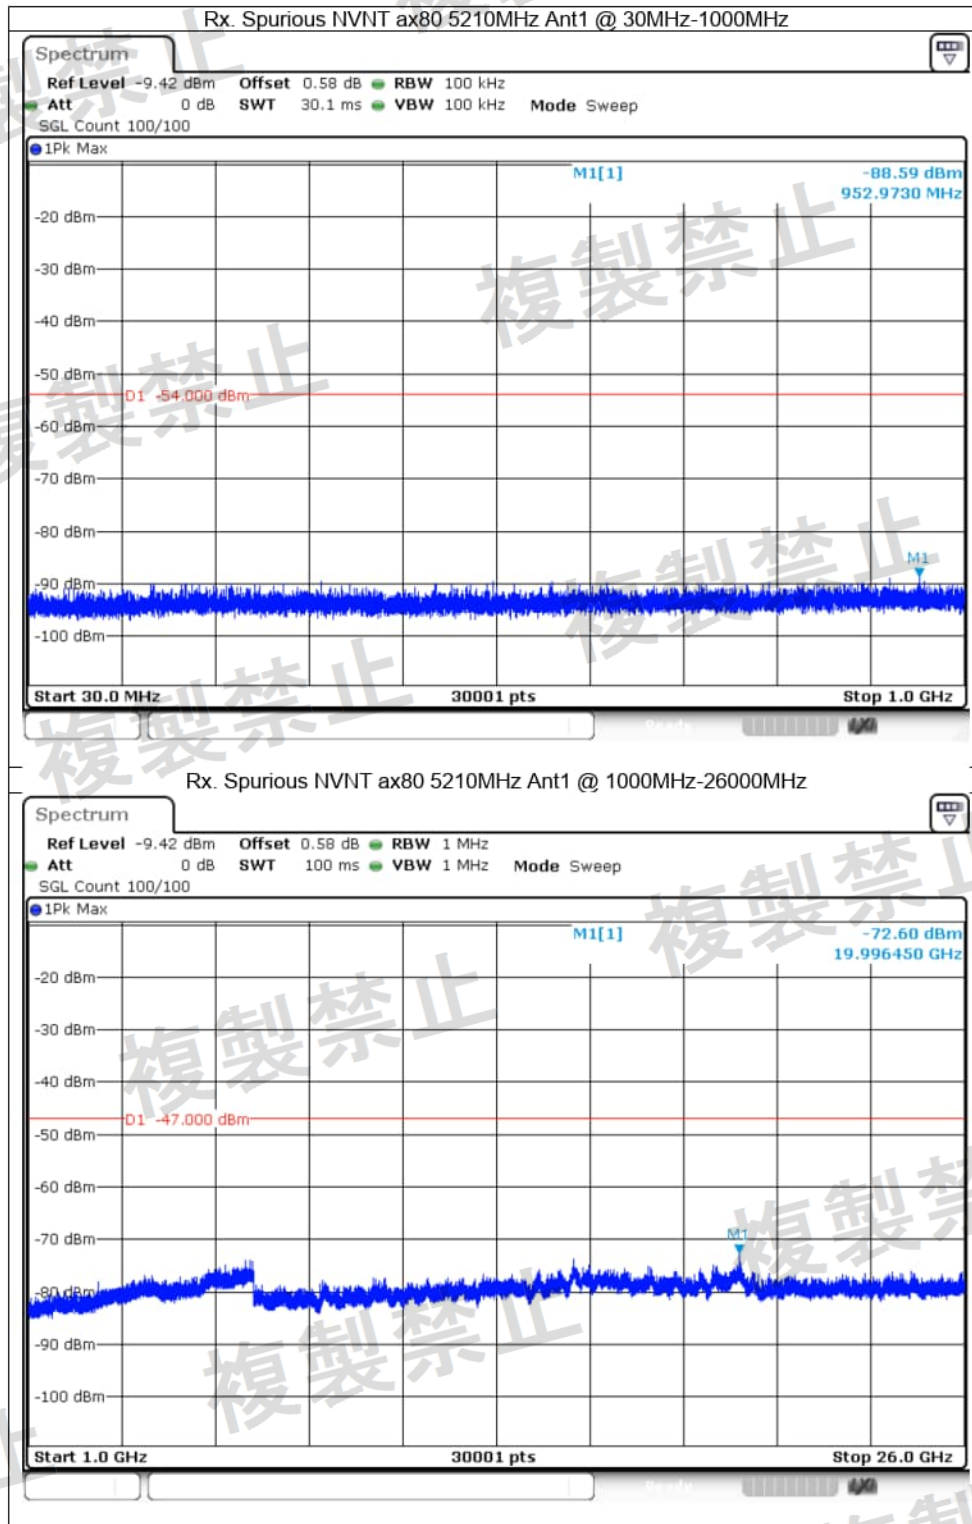



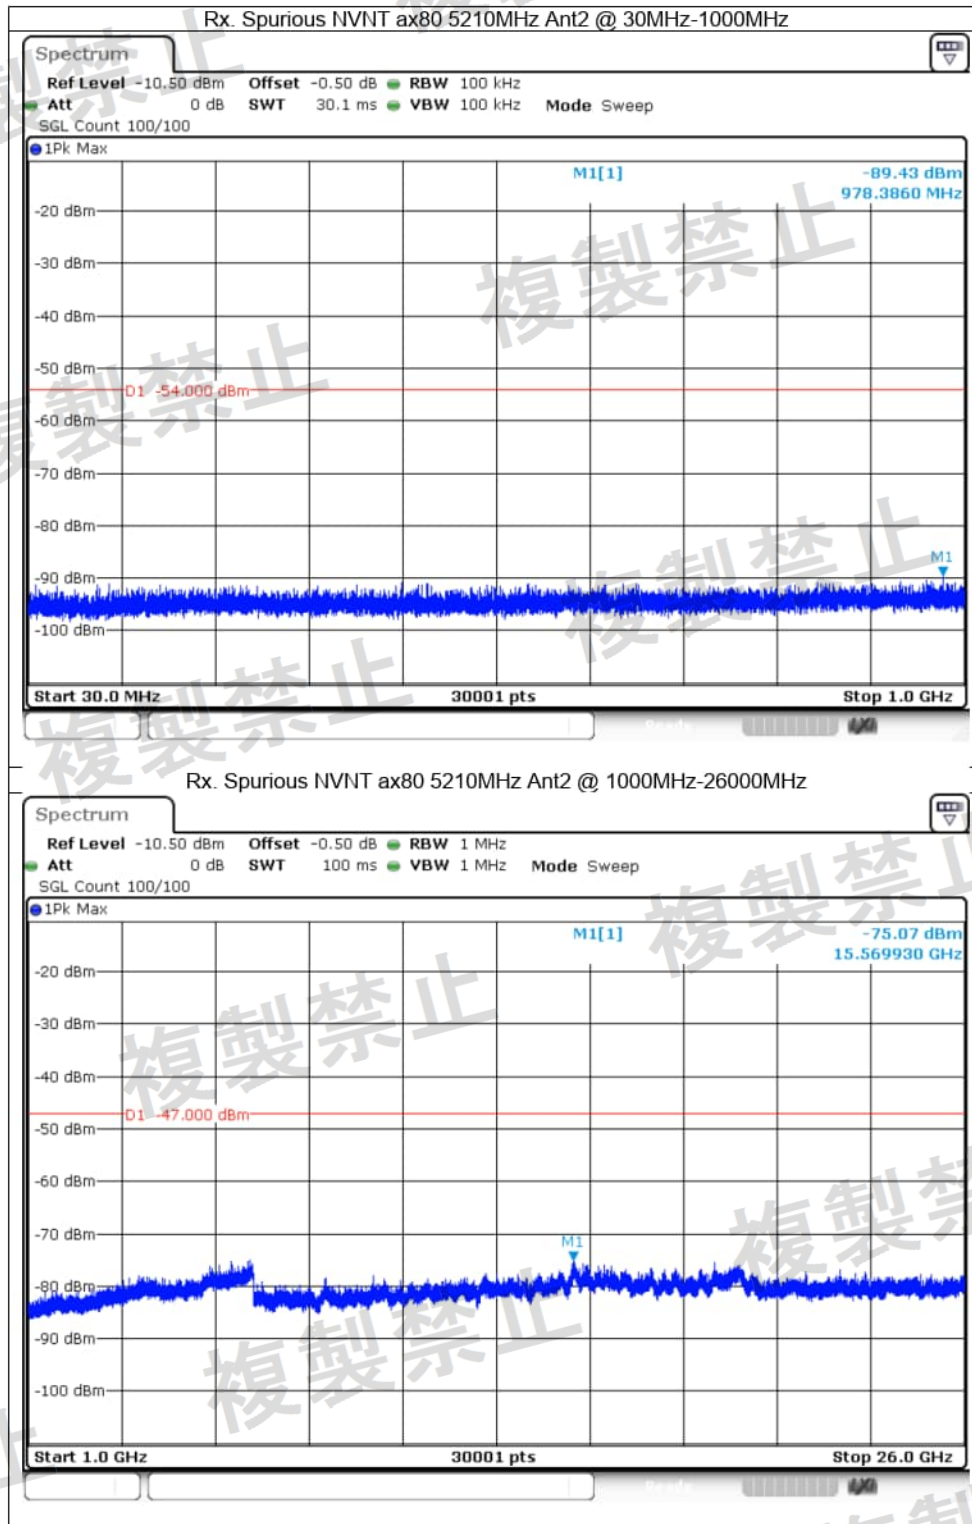


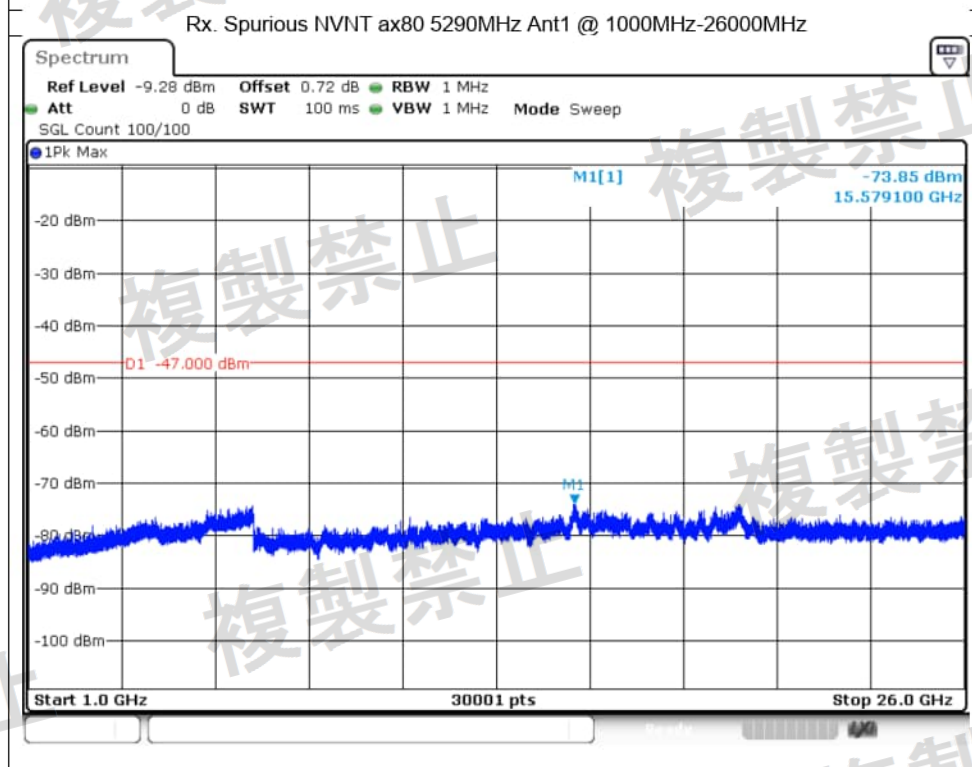
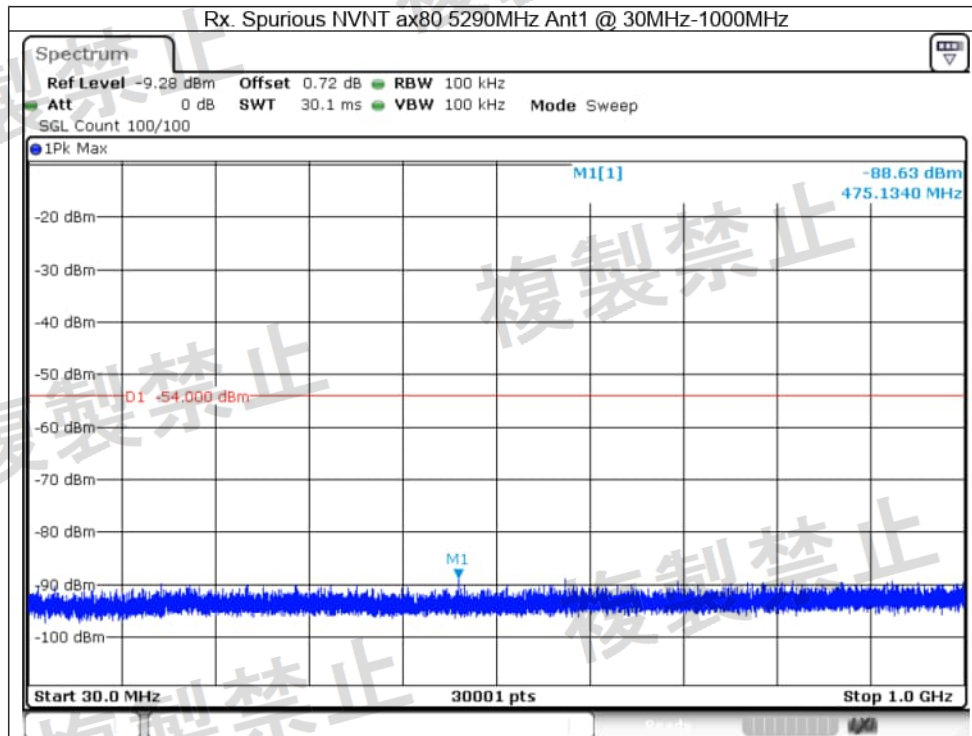


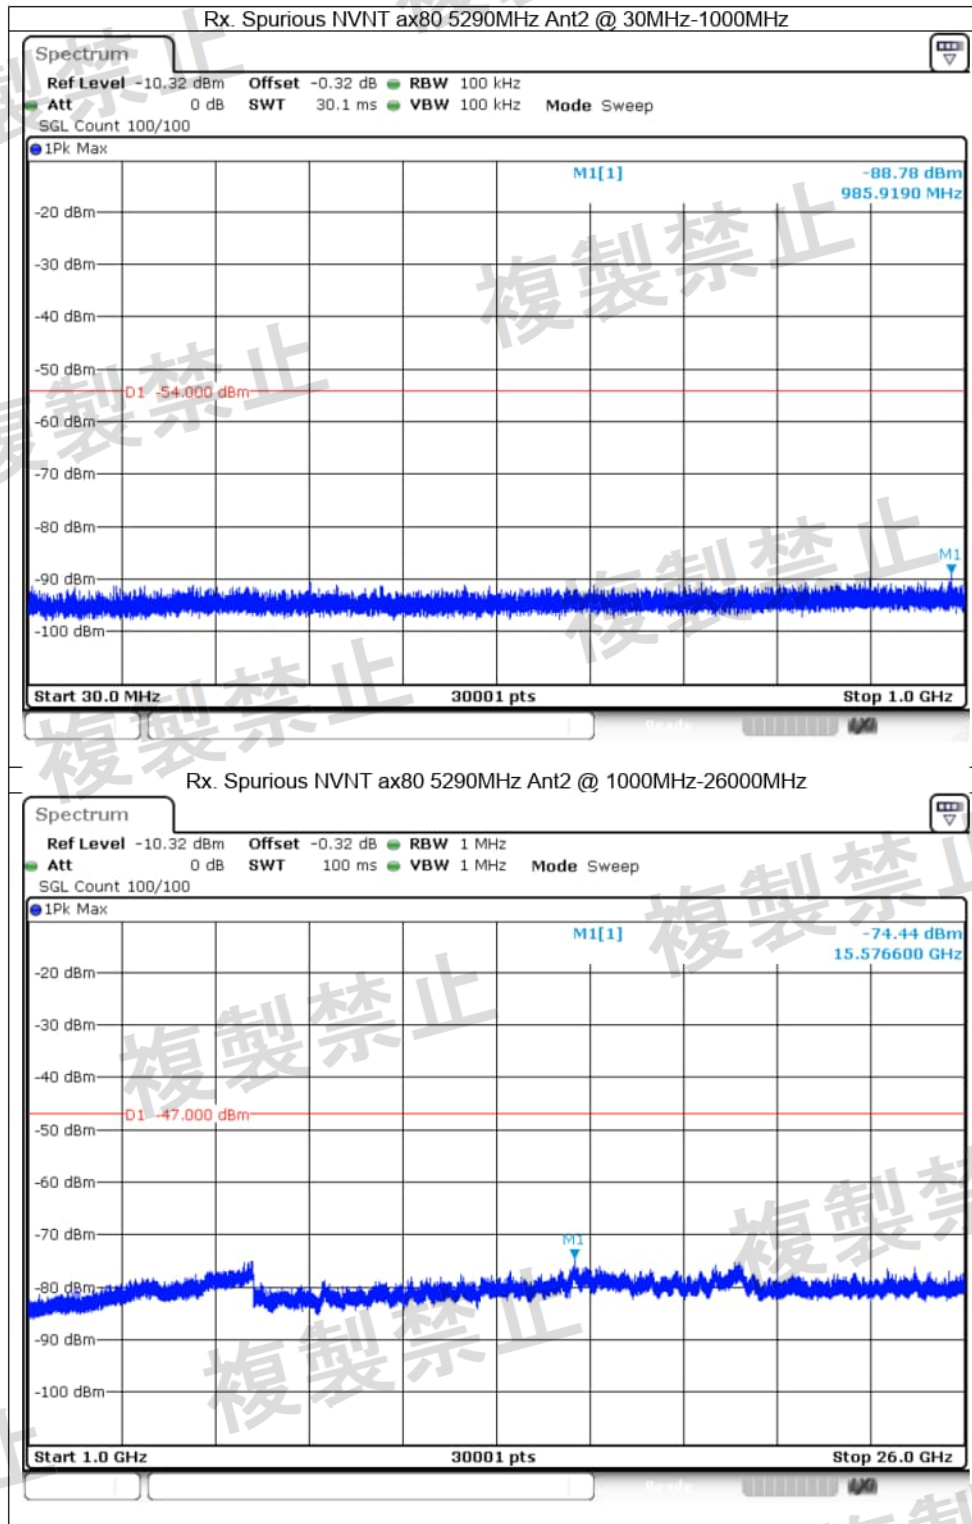


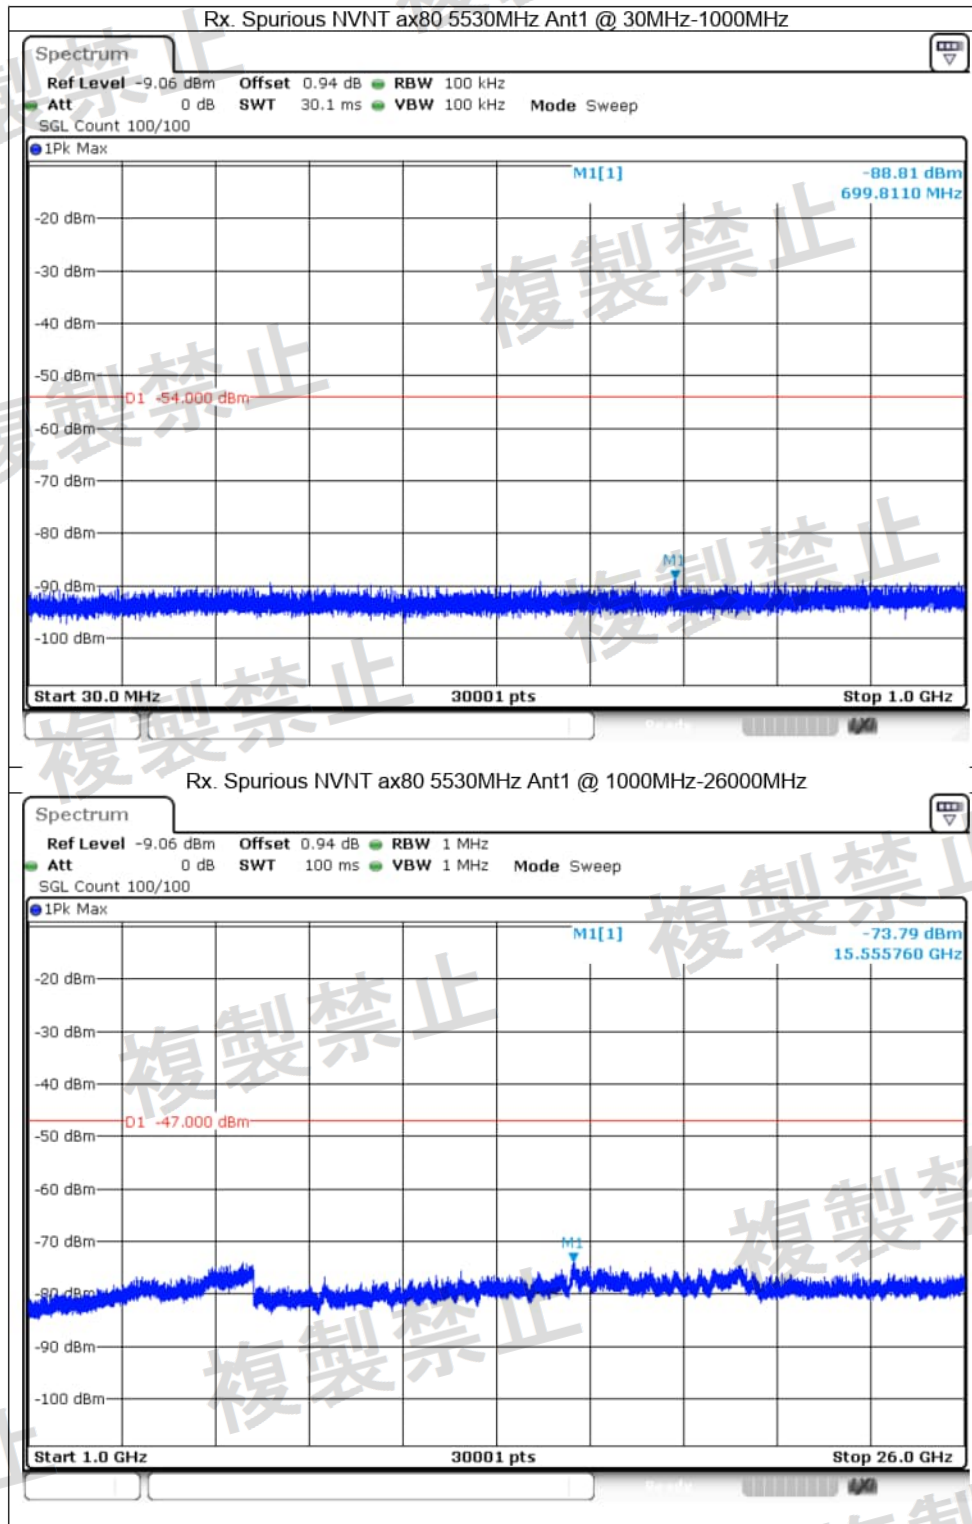


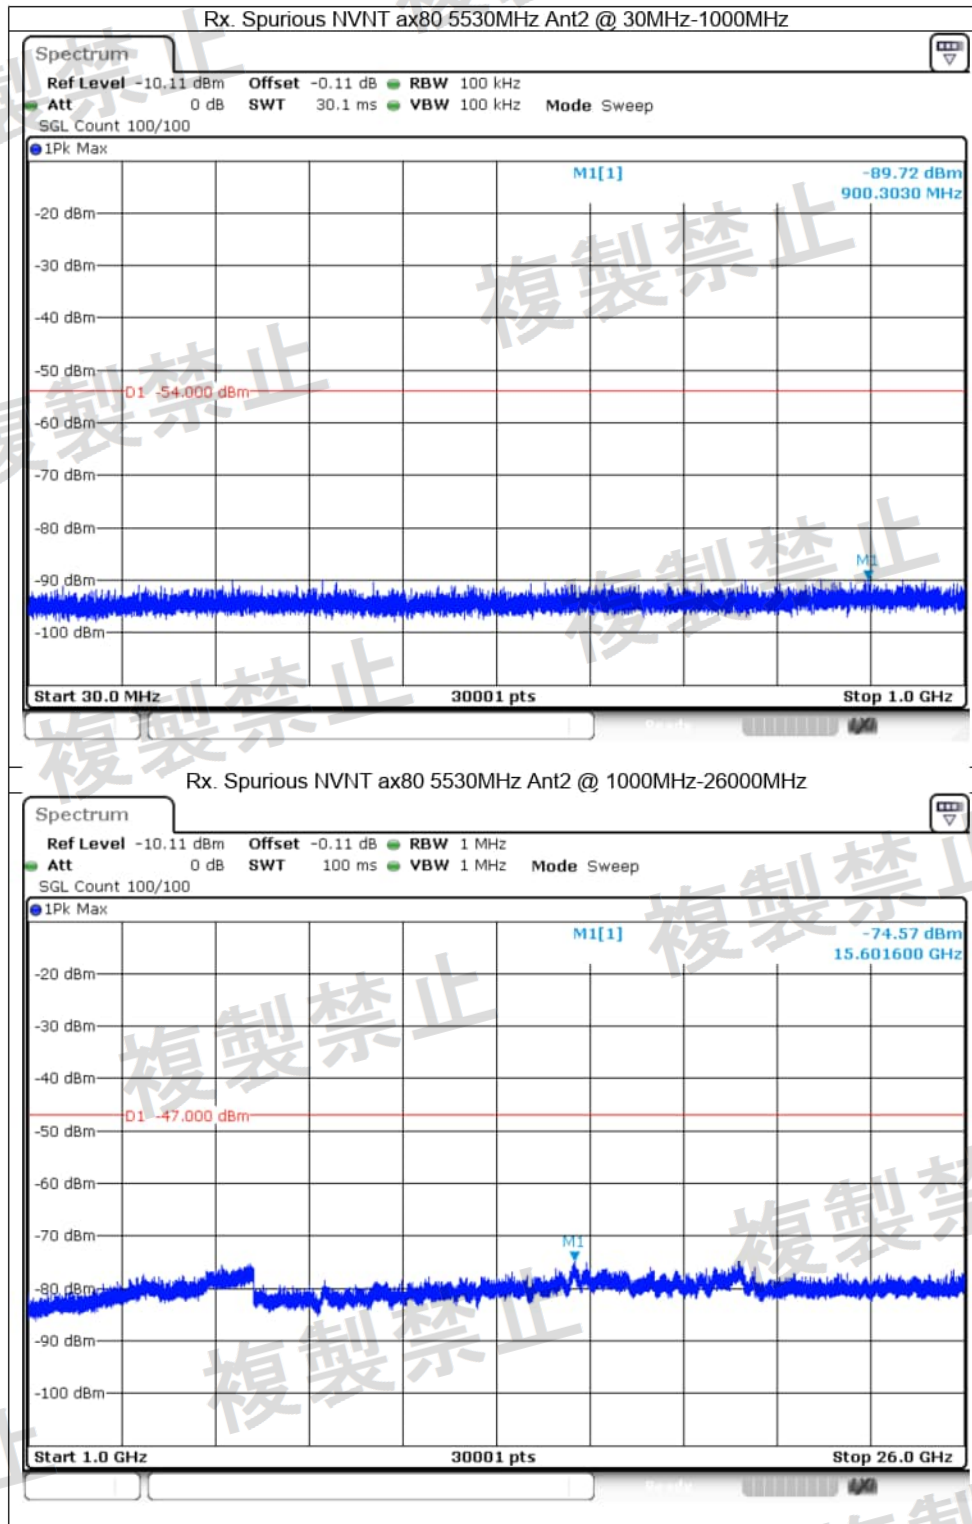

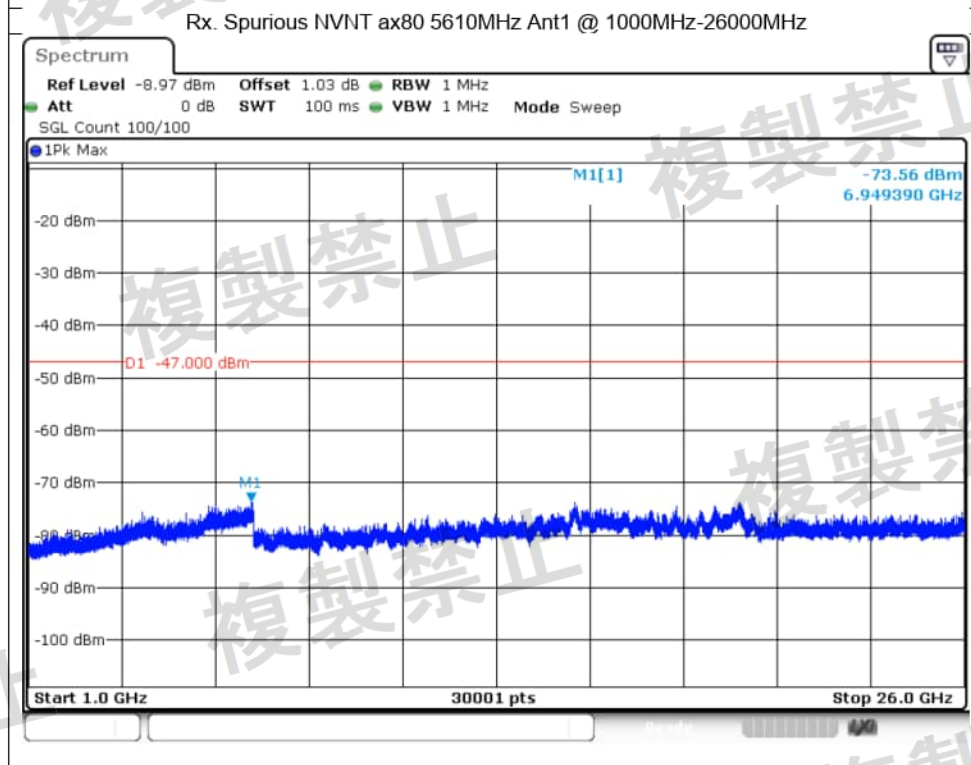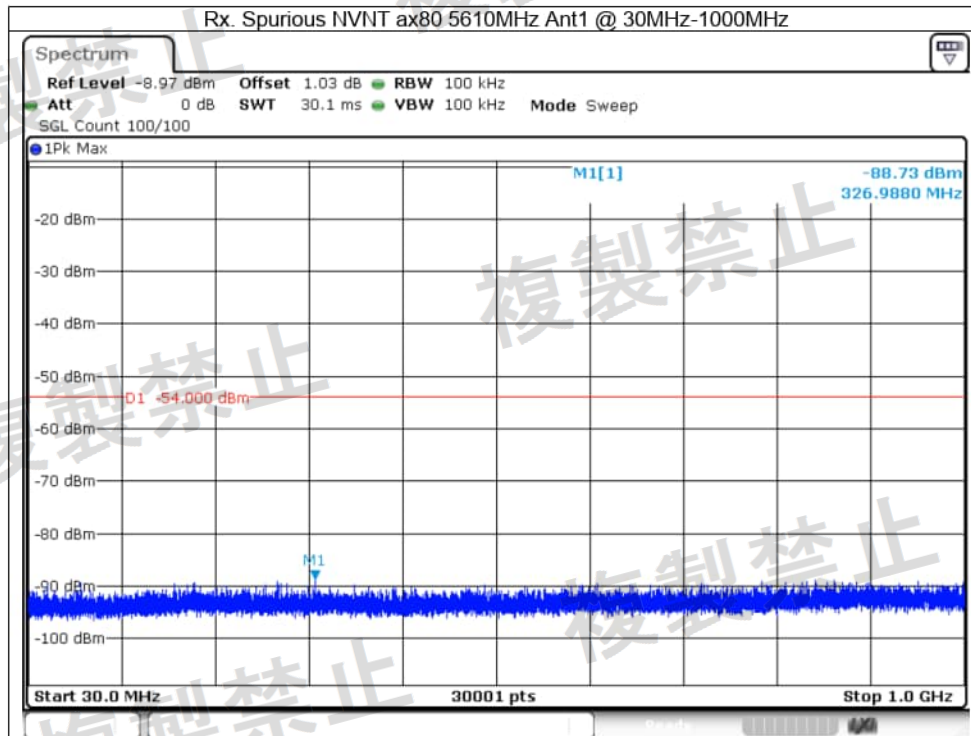

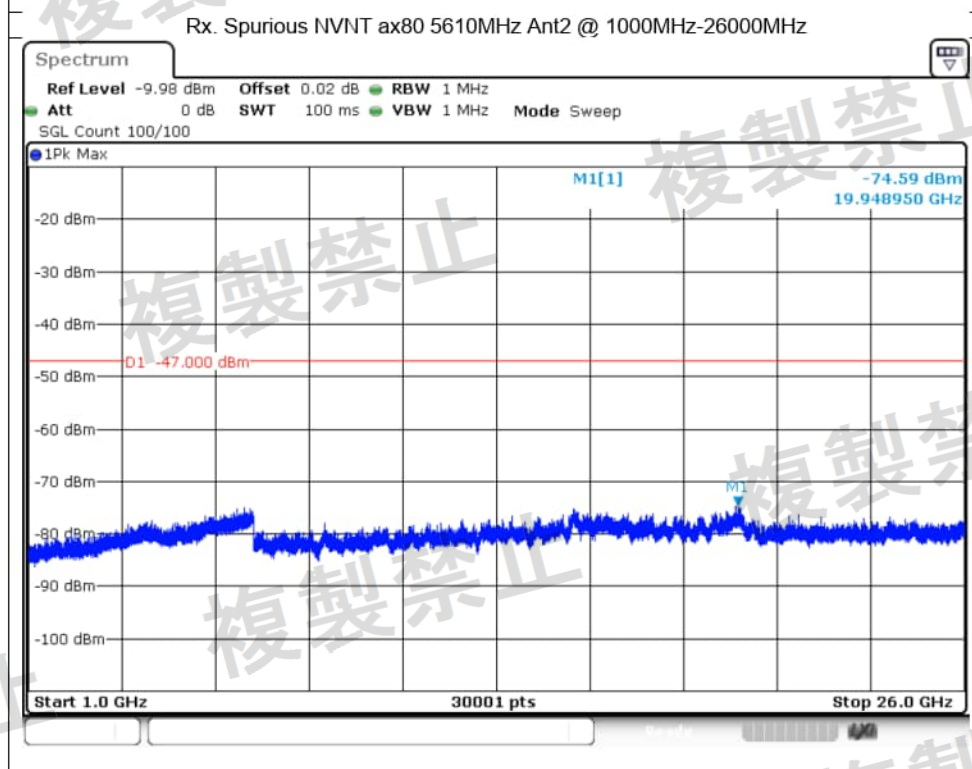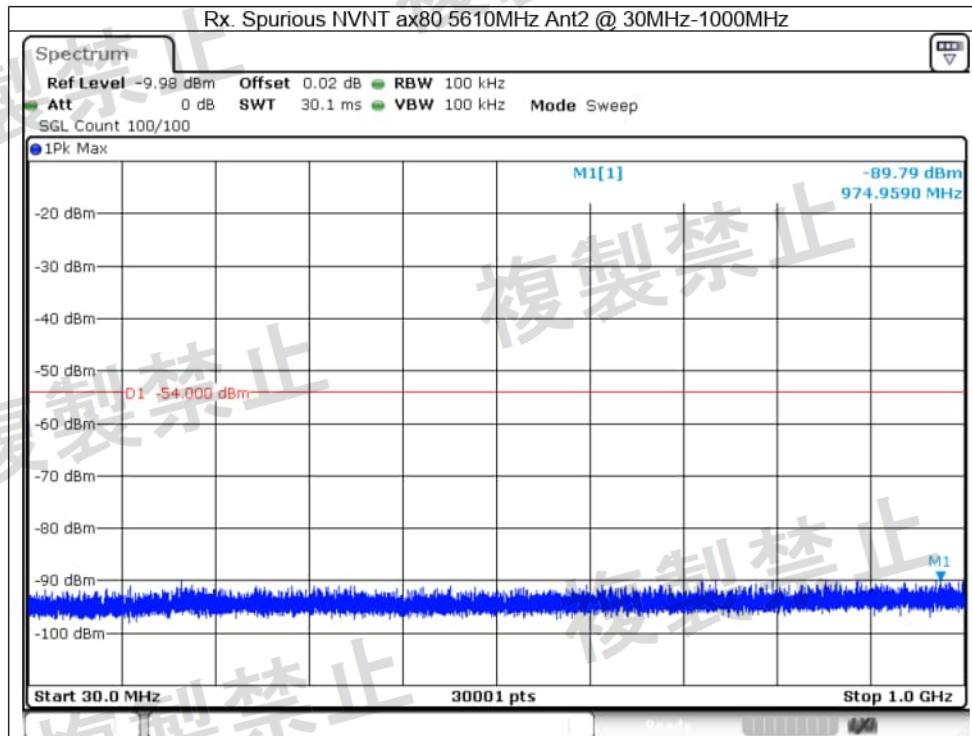

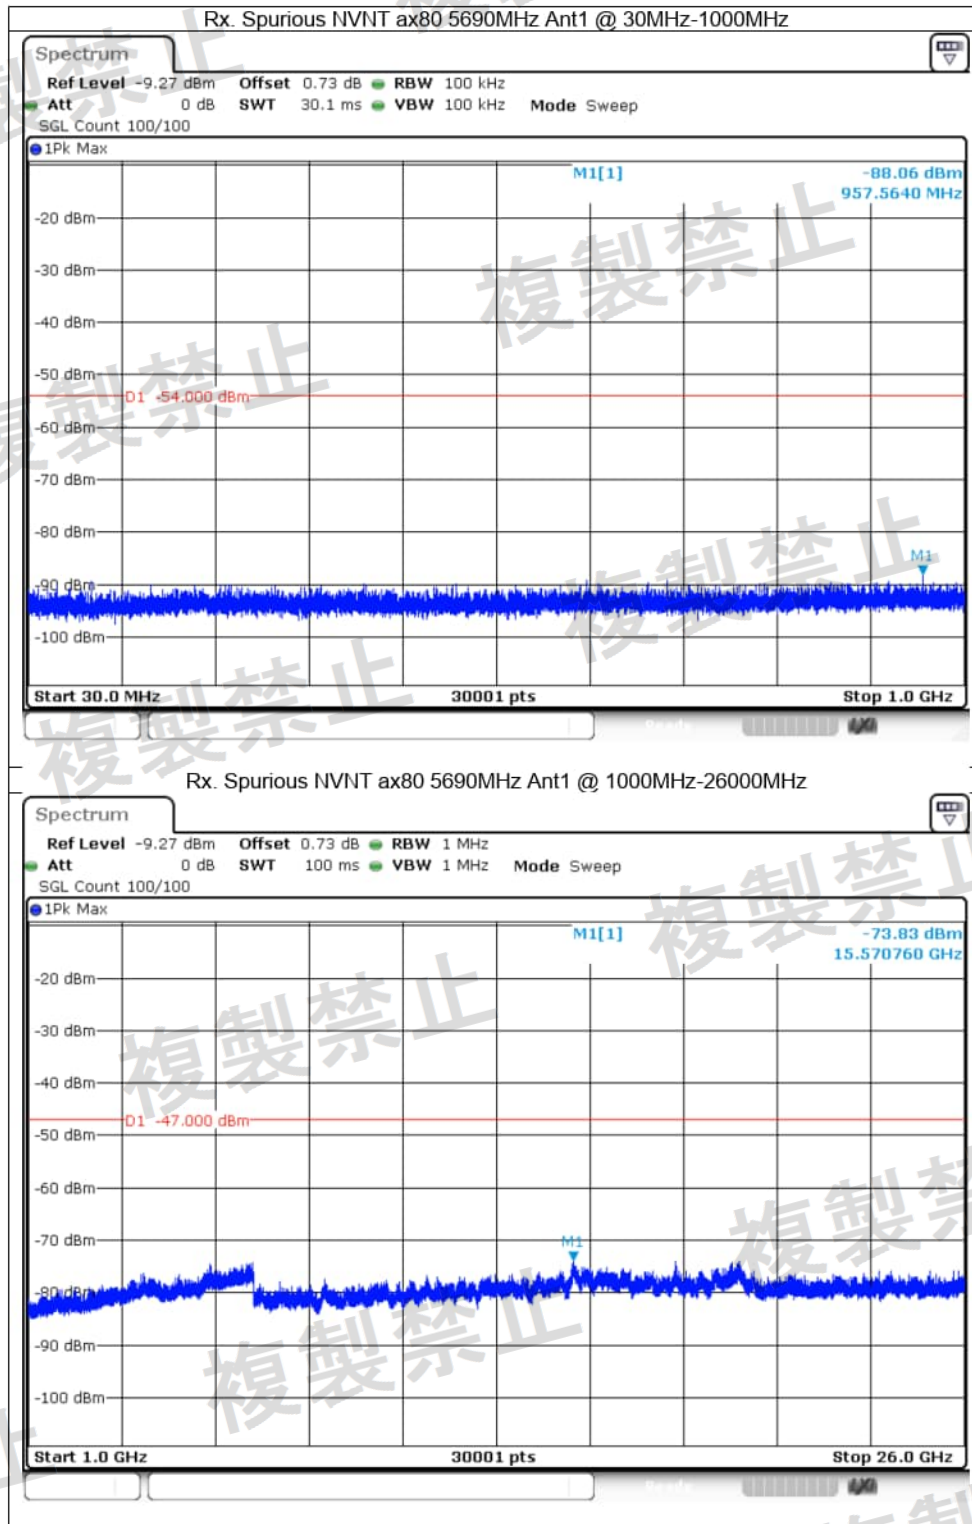

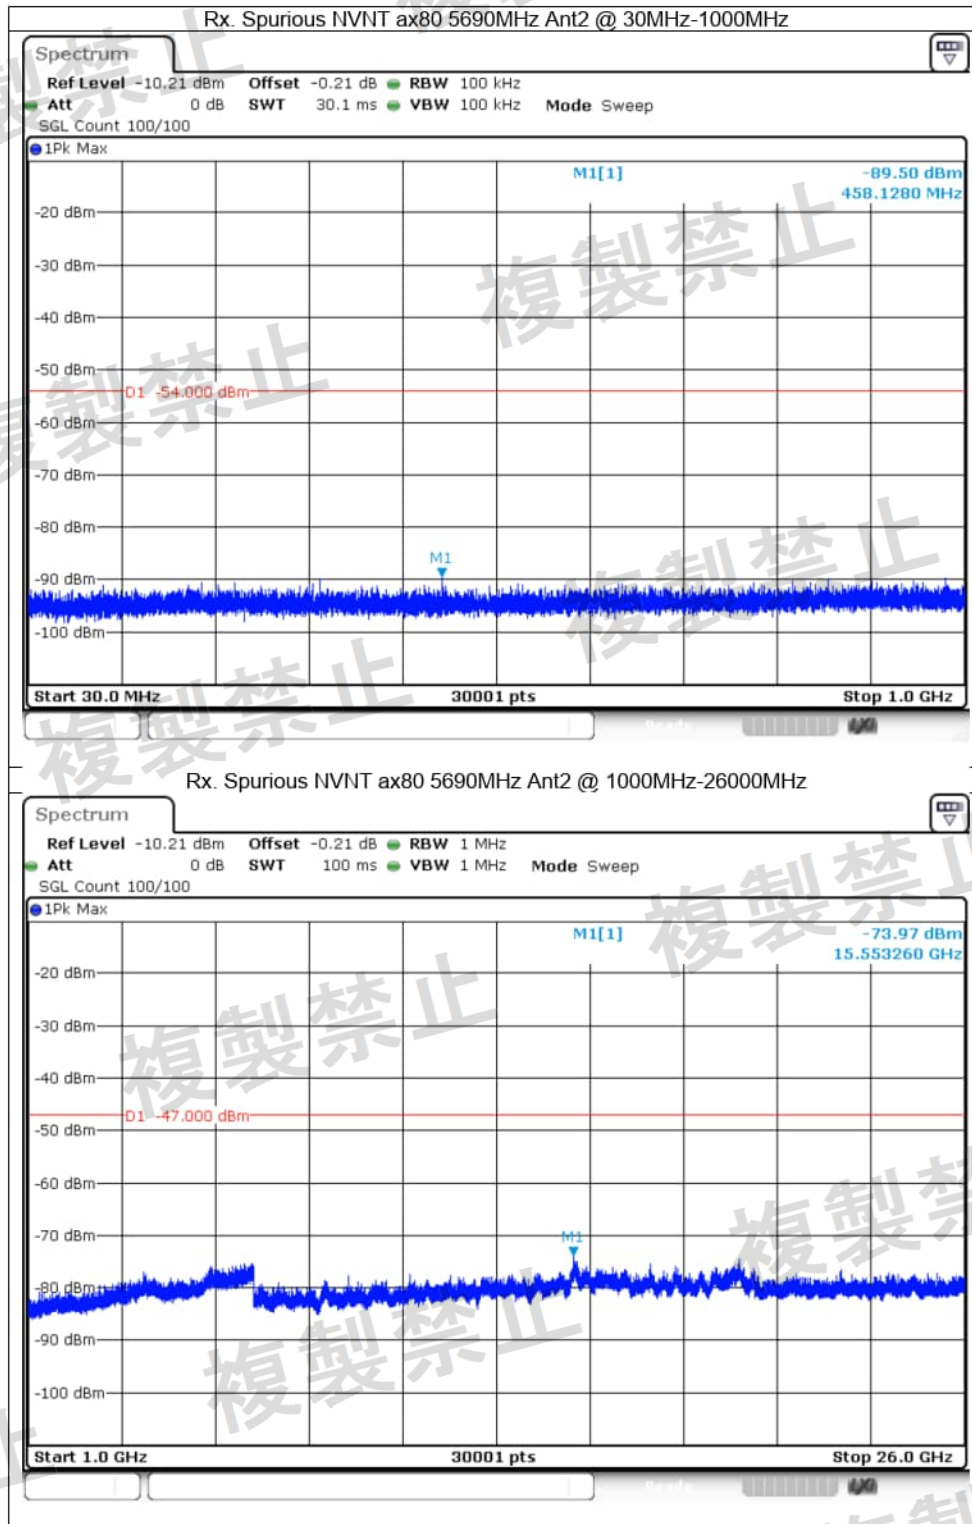

3.8.4 Result

The equipment met the requirement of this clause.



3.9 Transmission Burst Length

3.9.1 Test condition

Date of testing:	2023.12.15
Ambient temperature:	22.1 °C
Relative humidity:	52.6 %
Atmosphere Pressure:	100.9 KPa

3.9.2 Limit

≤8ms

3.9.3 Test Result



Condition	Mode	Frequency (MHz)	Antenna	Burst Length (ms)	Limit (ms)	Verdict
NVNT	a	5180	Ant1	1.396	8	Pass
NVNT	a	5200	Ant1	1.397	8	Pass
NVNT	a	5240	Ant1	1.397	8	Pass
NVNT	a	5260	Ant1	1.397	8	Pass
NVNT	a	5280	Ant1	1.397	8	Pass
NVNT	a	5320	Ant1	1.397	8	Pass
NVNT	a	5500	Ant1	1.397	8	Pass
NVNT	a	5600	Ant1	1.397	8	Pass
NVNT	a	5720	Ant1	1.397	8	Pass
NVNT	a	5180	Ant2	1.397	8	Pass
NVNT	a	5200	Ant2	1.397	8	Pass
NVNT	a	5240	Ant2	1.397	8	Pass
NVNT	a	5260	Ant2	1.397	8	Pass
NVNT	a	5280	Ant2	1.397	8	Pass
NVNT	a	5320	Ant2	1.397	8	Pass
NVNT	a	5500	Ant2	1.397	8	Pass
NVNT	a	5600	Ant2	1.397	8	Pass
NVNT	a	5720	Ant2	1.397	8	Pass
NVNT	n20	5180	Ant1	1.309	8	Pass
NVNT	n20	5200	Ant1	1.309	8	Pass
NVNT	n20	5240	Ant1	1.308	8	Pass
NVNT	n20	5260	Ant1	1.309	8	Pass
NVNT	n20	5280	Ant1	1.309	8	Pass
NVNT	n20	5320	Ant1	1.309	8	Pass
NVNT	n20	5500	Ant1	1.309	8	Pass
NVNT	n20	5600	Ant1	1.309	8	Pass
NVNT	n20	5720	Ant1	1.309	8	Pass
NVNT	n40	5190	Ant1	0.649	8	Pass
NVNT	n40	5230	Ant1	0.649	8	Pass
NVNT	n40	5270	Ant1	0.649	8	Pass
NVNT	n40	5310	Ant1	0.649	8	Pass
NVNT	n40	5510	Ant1	0.649	8	Pass
NVNT	n40	5590	Ant1	0.649	8	Pass
NVNT	n40	5710	Ant1	0.649	8	Pass
NVNT	n20	5180	Ant2	1.309	8	Pass
NVNT	n20	5200	Ant2	1.309	8	Pass
NVNT	n20	5240	Ant2	1.309	8	Pass
NVNT	n20	5260	Ant2	1.309	8	Pass
NVNT	n20	5280	Ant2	1.309	8	Pass
NVNT	n20	5320	Ant2	1.309	8	Pass
NVNT	n20	5500	Ant2	1.309	8	Pass
NVNT	n20	5600	Ant2	1.31	8	Pass
NVNT	n20	5720	Ant2	1.31	8	Pass
NVNT	n40	5190	Ant2	0.641	8	Pass
NVNT	n40	5230	Ant2	0.641	8	Pass
NVNT	n40	5270	Ant2	0.641	8	Pass
NVNT	n40	5310	Ant2	0.641	8	Pass
NVNT	n40	5510	Ant2	0.641	8	Pass





NVNT	n40	5590	Ant2	0.641	8	Pass
NVNT	n40	5710	Ant2	0.641	8	Pass
NVNT	ac20	5180	Ant1	0.685	8	Pass
NVNT	ac20	5200	Ant1	0.684	8	Pass
NVNT	ac20	5240	Ant1	0.685	8	Pass
NVNT	ac20	5260	Ant1	0.685	8	Pass
NVNT	ac20	5280	Ant1	0.685	8	Pass
NVNT	ac20	5320	Ant1	0.685	8	Pass
NVNT	ac20	5500	Ant1	0.685	8	Pass
NVNT	ac20	5600	Ant1	0.685	8	Pass
NVNT	ac20	5720	Ant1	0.685	8	Pass
NVNT	ac40	5190	Ant1	0.353	8	Pass
NVNT	ac40	5230	Ant1	0.353	8	Pass
NVNT	ac40	5270	Ant1	0.353	8	Pass
NVNT	ac40	5310	Ant1	0.353	8	Pass
NVNT	ac40	5510	Ant1	0.353	8	Pass
NVNT	ac40	5590	Ant1	0.353	8	Pass
NVNT	ac40	5710	Ant1	0.353	8	Pass
NVNT	ac80	5210	Ant1	0.188	8	Pass
NVNT	ac80	5290	Ant1	0.189	8	Pass
NVNT	ac80	5530	Ant1	0.189	8	Pass
NVNT	ac80	5610	Ant1	0.188	8	Pass
NVNT	ac80	5690	Ant1	0.188	8	Pass
NVNT	ac20	5180	Ant2	0.685	8	Pass
NVNT	ac20	5200	Ant2	0.685	8	Pass
NVNT	ac20	5240	Ant2	0.685	8	Pass
NVNT	ac20	5260	Ant2	0.685	8	Pass
NVNT	ac20	5280	Ant2	0.685	8	Pass
NVNT	ac20	5320	Ant2	0.686	8	Pass
NVNT	ac20	5500	Ant2	0.685	8	Pass
NVNT	ac20	5600	Ant2	0.685	8	Pass
NVNT	ac20	5720	Ant2	0.685	8	Pass
NVNT	ac40	5190	Ant2	0.345	8	Pass
NVNT	ac40	5230	Ant2	0.345	8	Pass
NVNT	ac40	5270	Ant2	0.345	8	Pass
NVNT	ac40	5310	Ant2	0.345	8	Pass
NVNT	ac40	5510	Ant2	0.345	8	Pass
NVNT	ac40	5590	Ant2	0.345	8	Pass
NVNT	ac40	5710	Ant2	0.345	8	Pass
NVNT	ac80	5210	Ant2	0.181	8	Pass
NVNT	ac80	5290	Ant2	0.18	8	Pass
NVNT	ac80	5530	Ant2	0.188	8	Pass
NVNT	ac80	5610	Ant2	0.188	8	Pass
NVNT	ac80	5690	Ant2	0.18	8	Pass
NVNT	ax20	5180	Ant1	0.542	8	Pass
NVNT	ax20	5200	Ant1	0.543	8	Pass
NVNT	ax20	5240	Ant1	0.542	8	Pass
NVNT	ax20	5260	Ant1	0.542	8	Pass
NVNT	ax20	5280	Ant1	0.543	8	Pass
NVNT	ax20	5320	Ant1	0.542	8	Pass
NVNT	ax20	5500	Ant1	0.543	8	Pass
NVNT	ax20	5600	Ant1	0.542	8	Pass
NVNT	ax20	5720	Ant1	0.542	8	Pass
NVNT	ax40	5190	Ant1	0.301	8	Pass
NVNT	ax40	5230	Ant1	0.301	8	Pass
NVNT	ax40	5270	Ant1	0.302	8	Pass
NVNT	ax40	5310	Ant1	0.302	8	Pass
NVNT	ax40	5510	Ant1	0.301	8	Pass
NVNT	ax40	5590	Ant1	0.302	8	Pass
NVNT	ax40	5710	Ant1	0.301	8	Pass
NVNT	ax80	5210	Ant1	0.175	8	Pass
NVNT	ax80	5290	Ant1	0.167	8	Pass
NVNT	ax80	5530	Ant1	0.175	8	Pass
NVNT	ax80	5610	Ant1	0.175	8	Pass
NVNT	ax80	5690	Ant1	0.175	8	Pass
NVNT	ax20	5180	Ant2	0.542	8	Pass
NVNT	ax20	5200	Ant2	0.542	8	Pass
NVNT	ax20	5240	Ant2	0.543	8	Pass
NVNT	ax20	5260	Ant2	0.542	8	Pass
NVNT	ax20	5280	Ant2	0.542	8	Pass
NVNT	ax20	5320	Ant2	0.542	8	Pass
NVNT	ax20	5500	Ant2	0.542	8	Pass






NVNT	ax20	5600	Ant2	0.542	8	Pass
NVNT	ax20	5720	Ant2	0.543	8	Pass
NVNT	ax40	5190	Ant2	0.293	8	Pass
NVNT	ax40	5230	Ant2	0.294	8	Pass
NVNT	ax40	5270	Ant2	0.293	8	Pass
NVNT	ax40	5310	Ant2	0.293	8	Pass
NVNT	ax40	5510	Ant2	0.293	8	Pass
NVNT	ax40	5590	Ant2	0.294	8	Pass
NVNT	ax40	5710	Ant2	0.294	8	Pass
NVNT	ax80	5210	Ant2	0.167	8	Pass
NVNT	ax80	5290	Ant2	0.167	8	Pass
NVNT	ax80	5530	Ant2	0.167	8	Pass
NVNT	ax80	5610	Ant2	0.167	8	Pass
NVNT	ax80	5690	Ant2	0.167	8	Pass

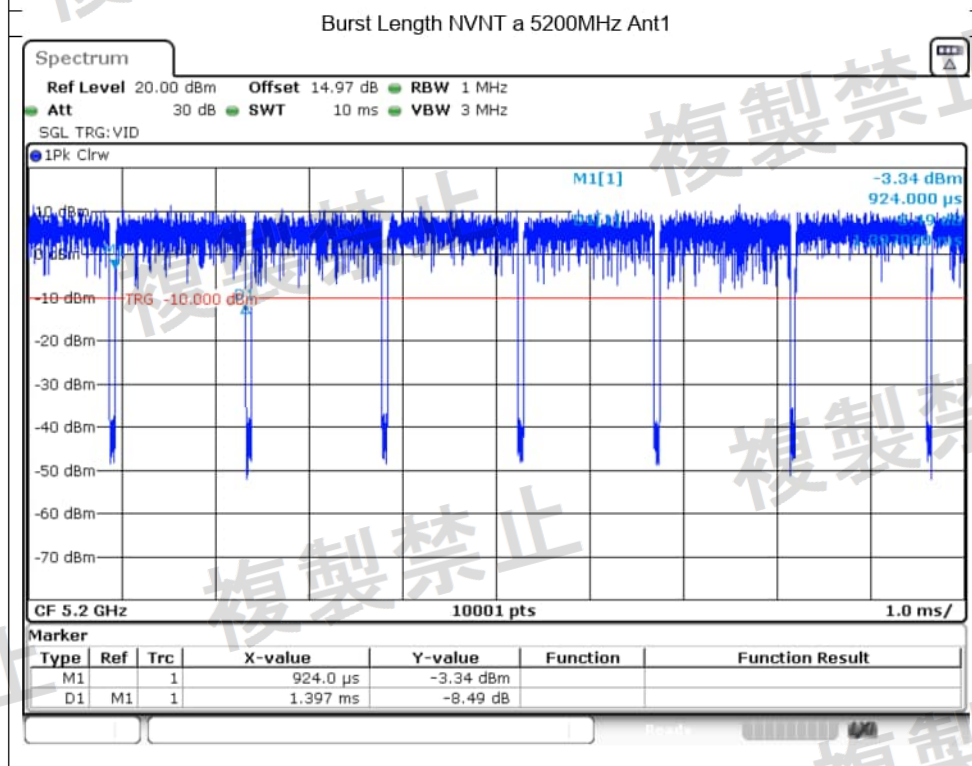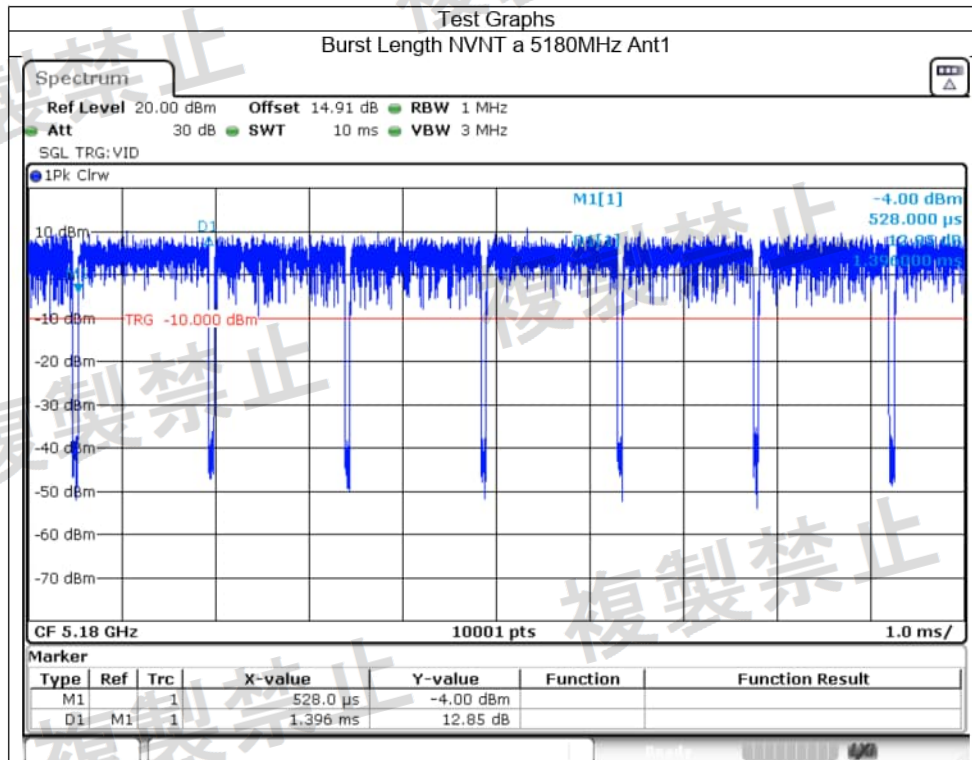

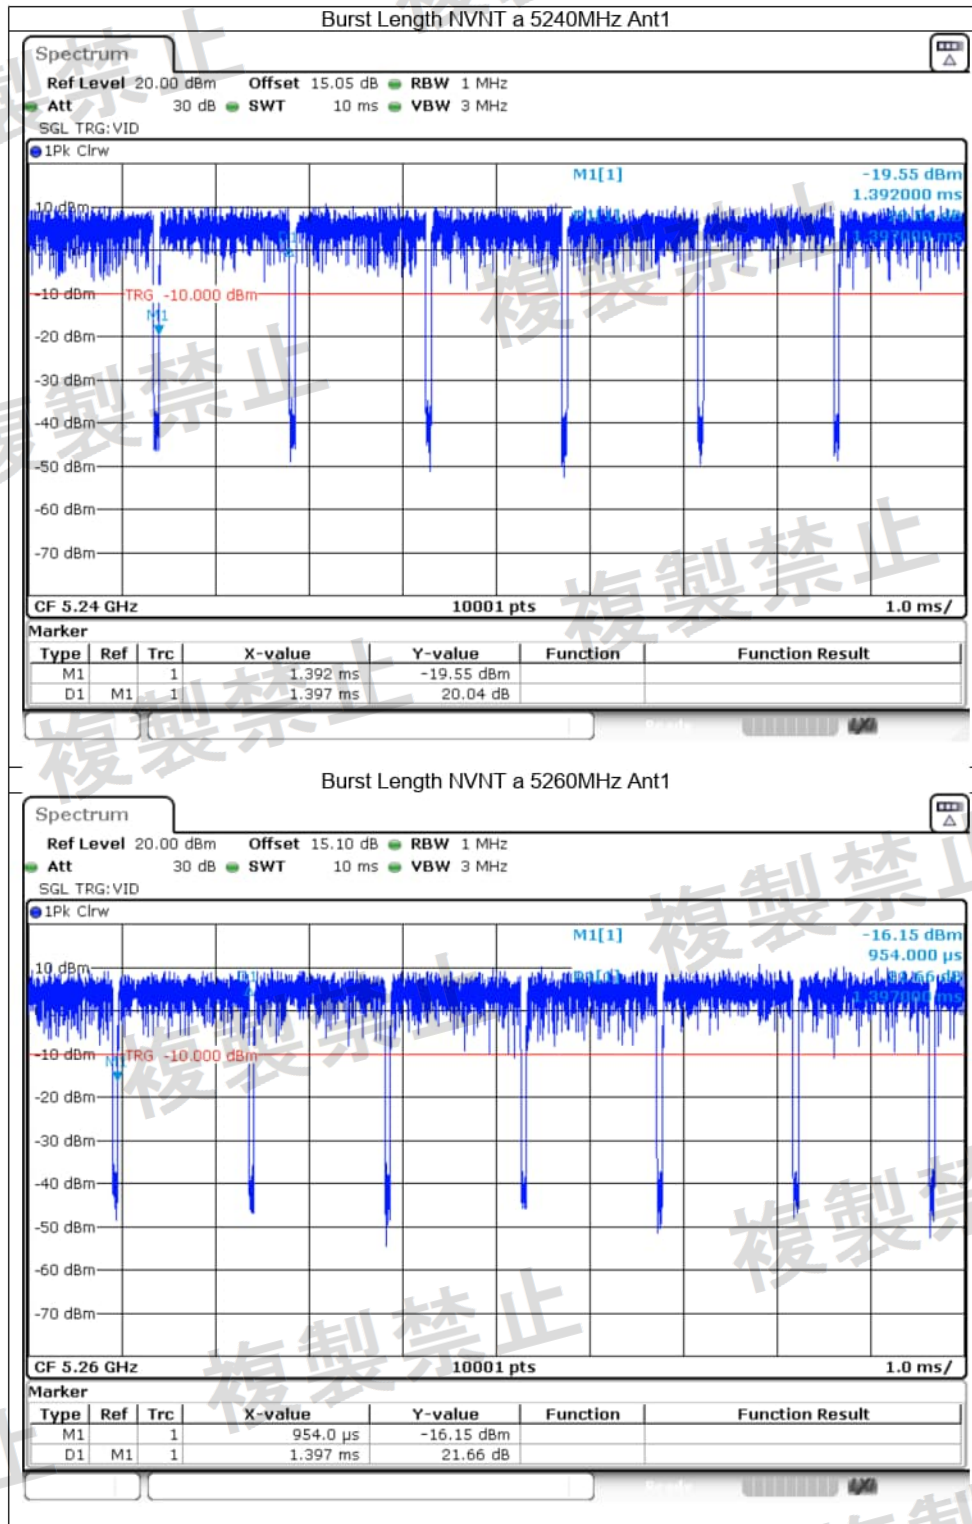

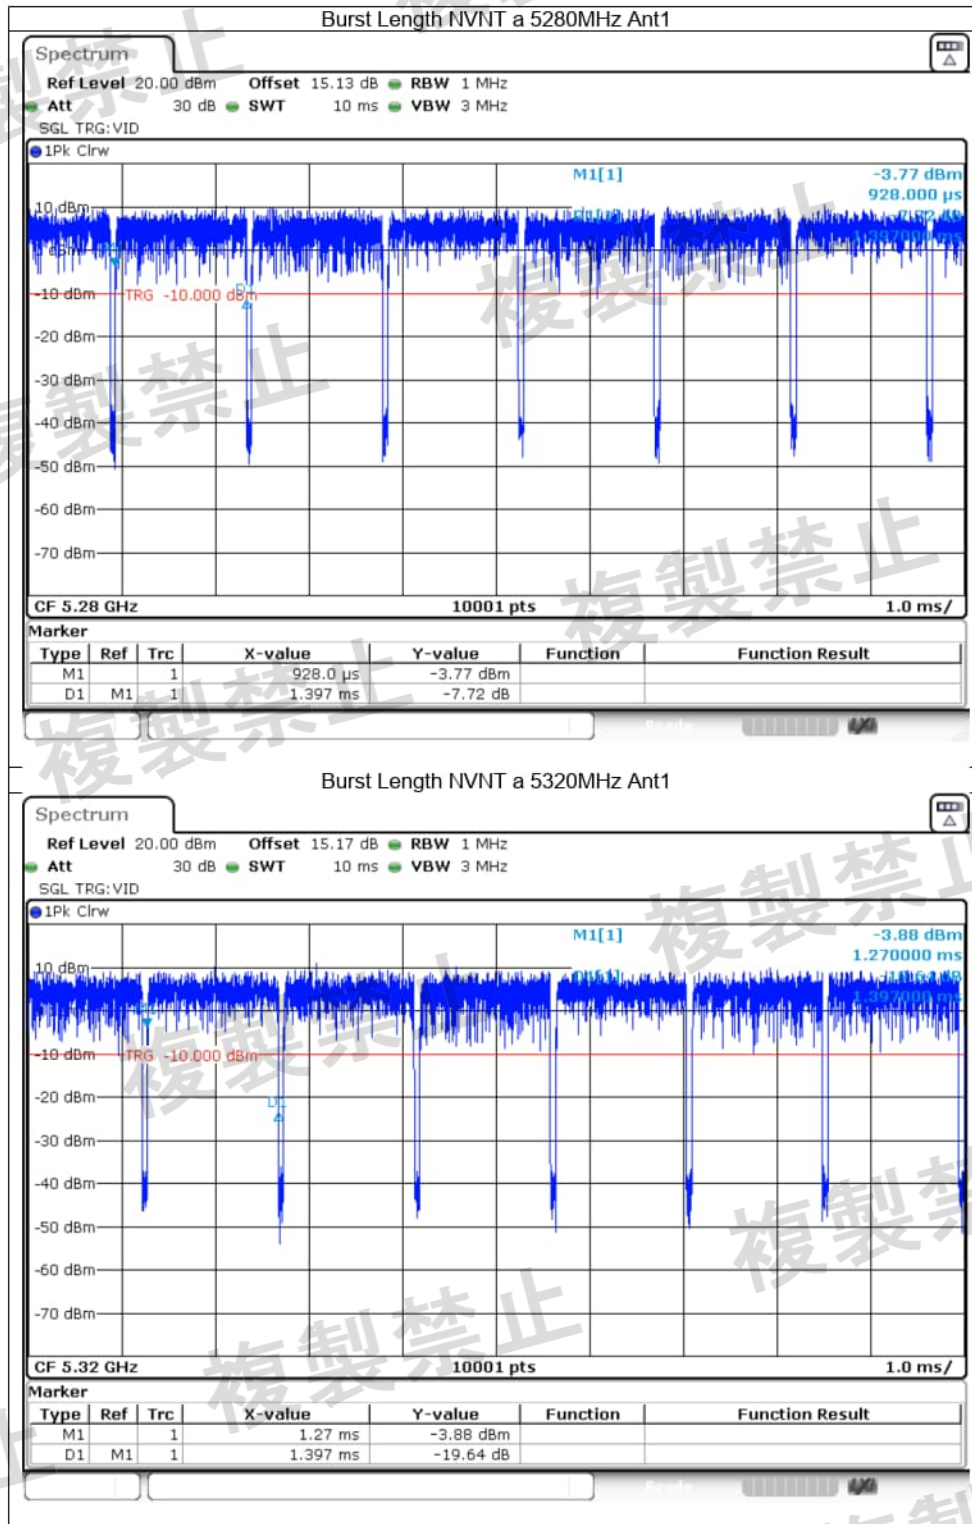


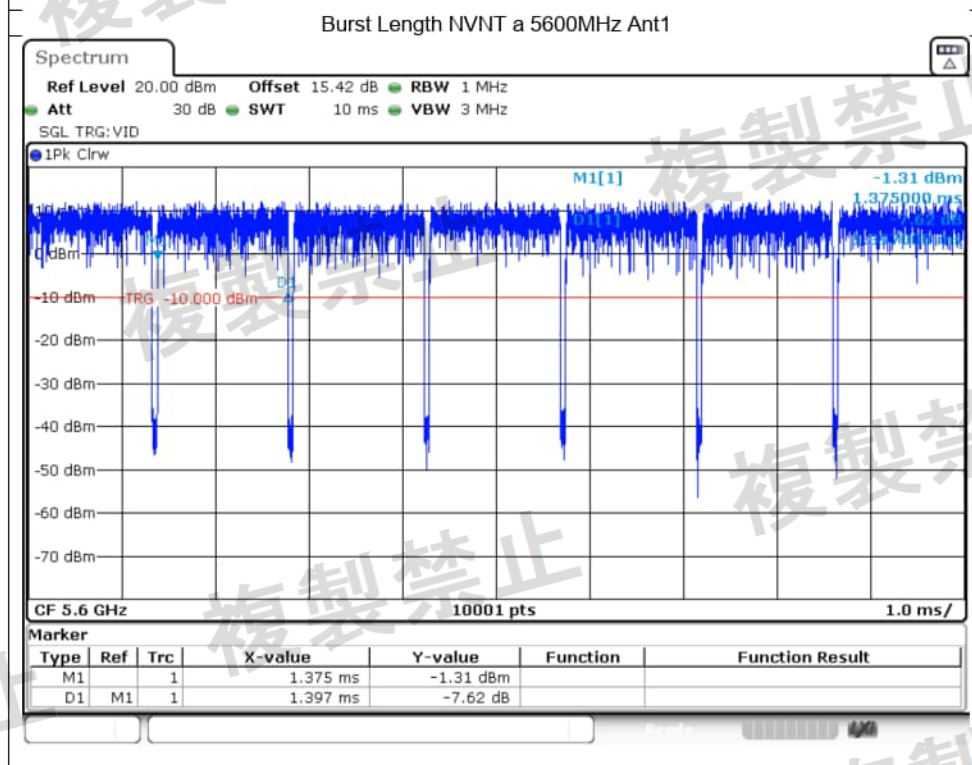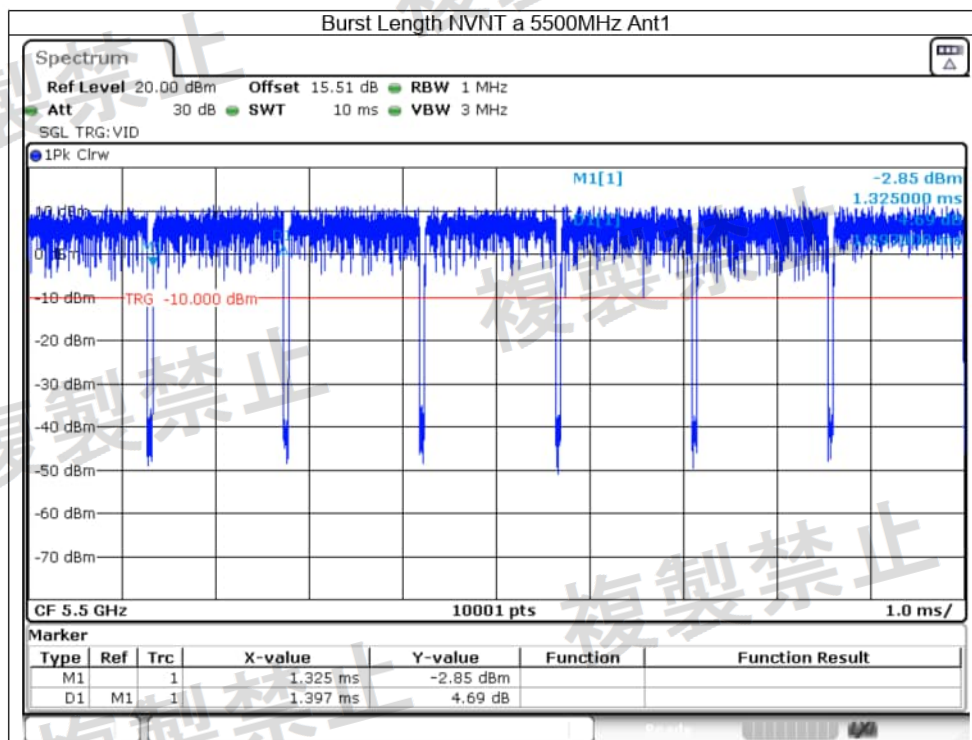

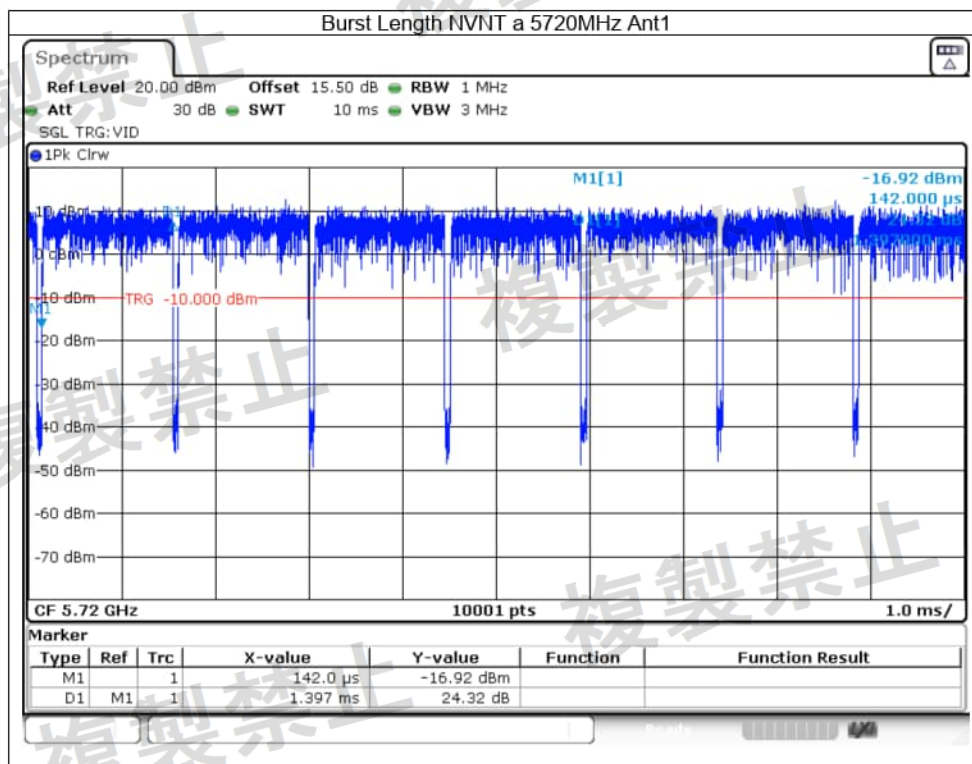


Test Graphs

Burst Length NVNT a 5180MHz Ant2

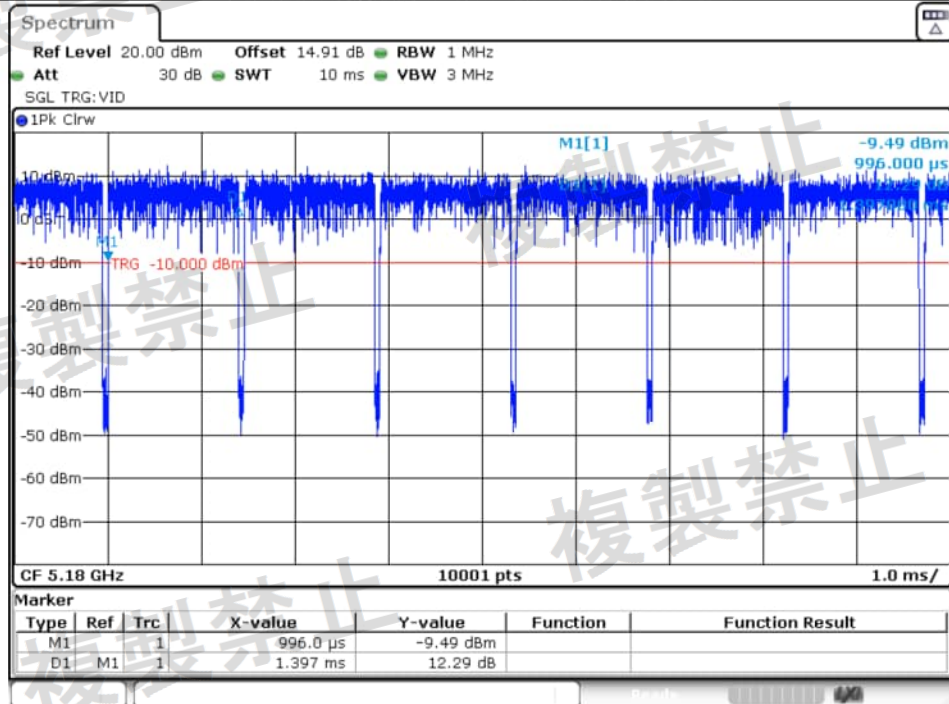


Burst Length NVNT a 5200MHz Ant2

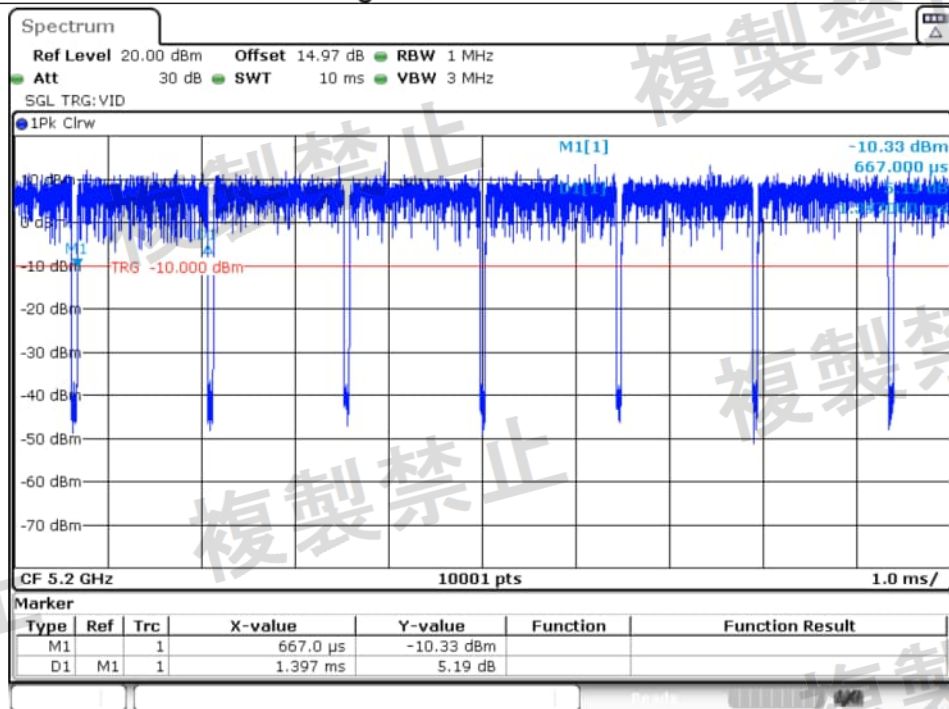





Burst Length NVNT a 5240MHz Ant2

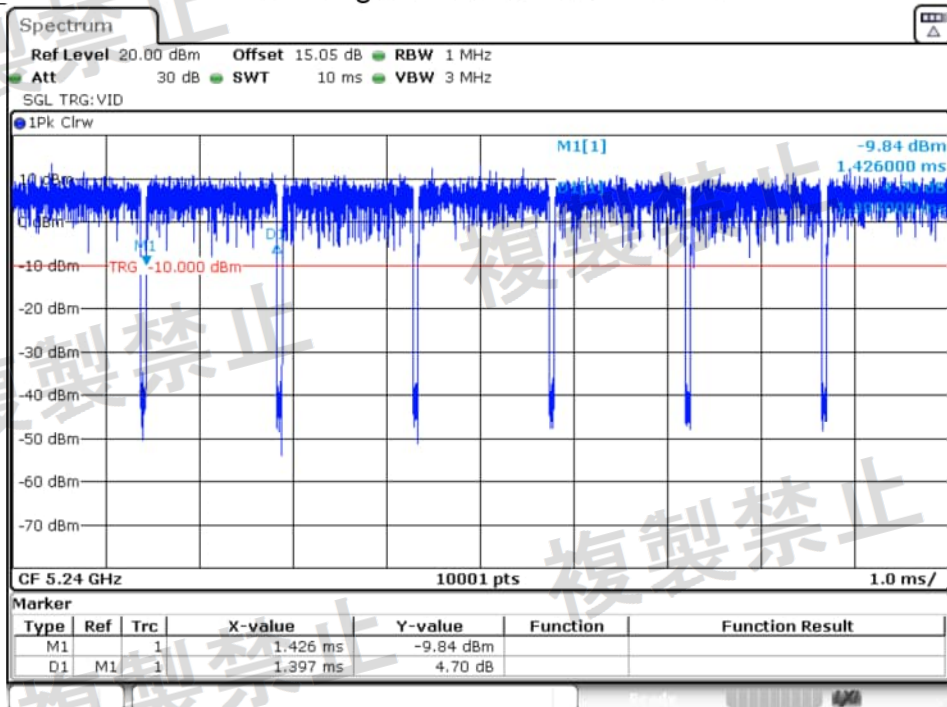


Burst Length NVNT a 5260MHz Ant2

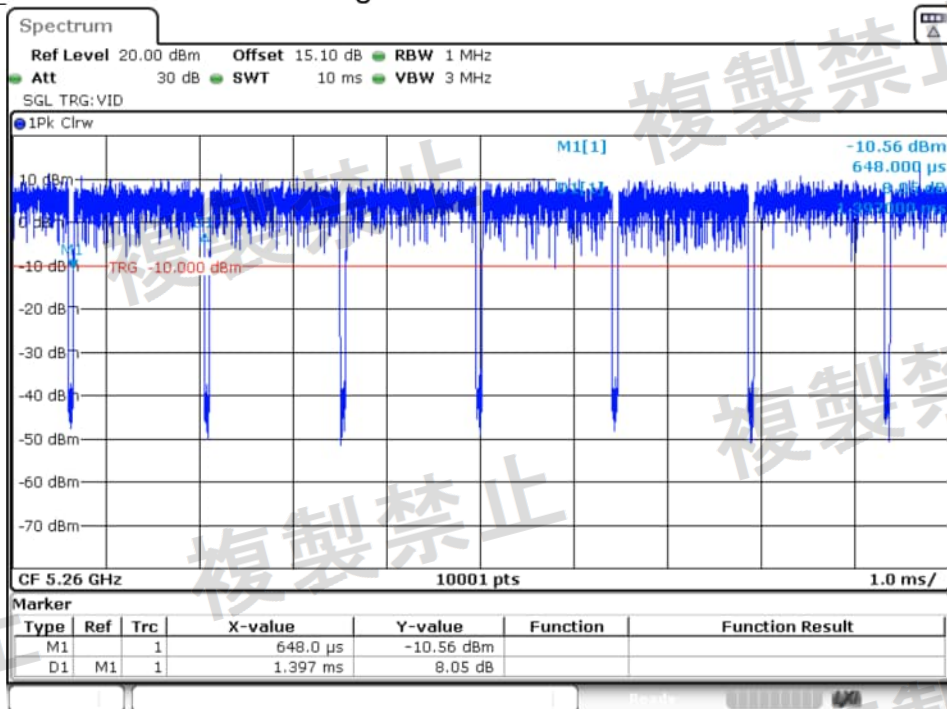


Burst Length NVNT a 5280MHz Ant2

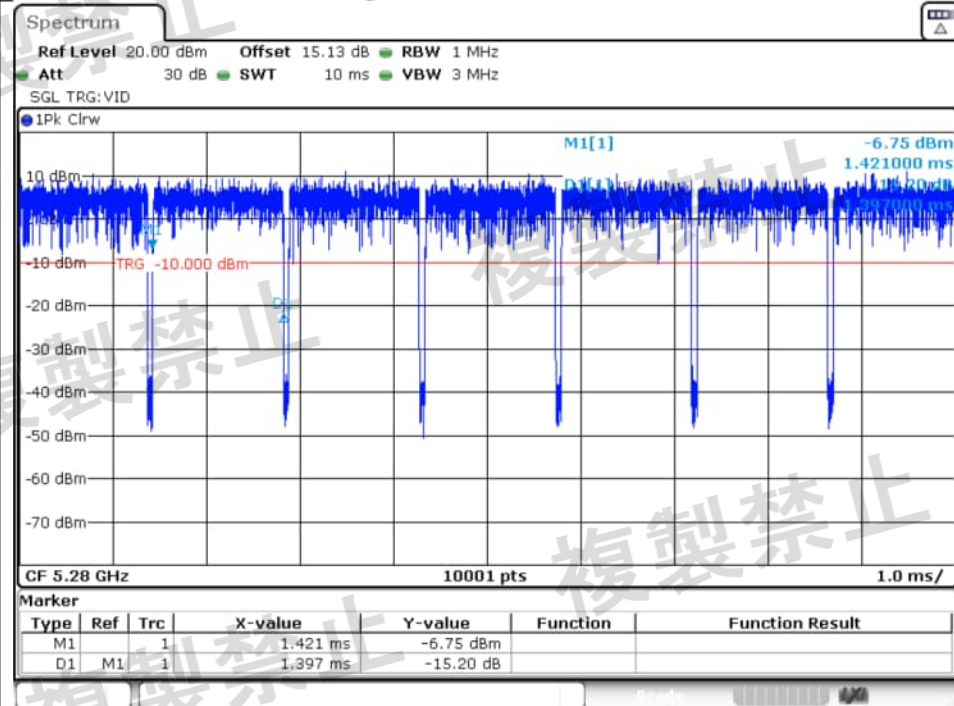


Burst Length NVNT a 5320MHz Ant2

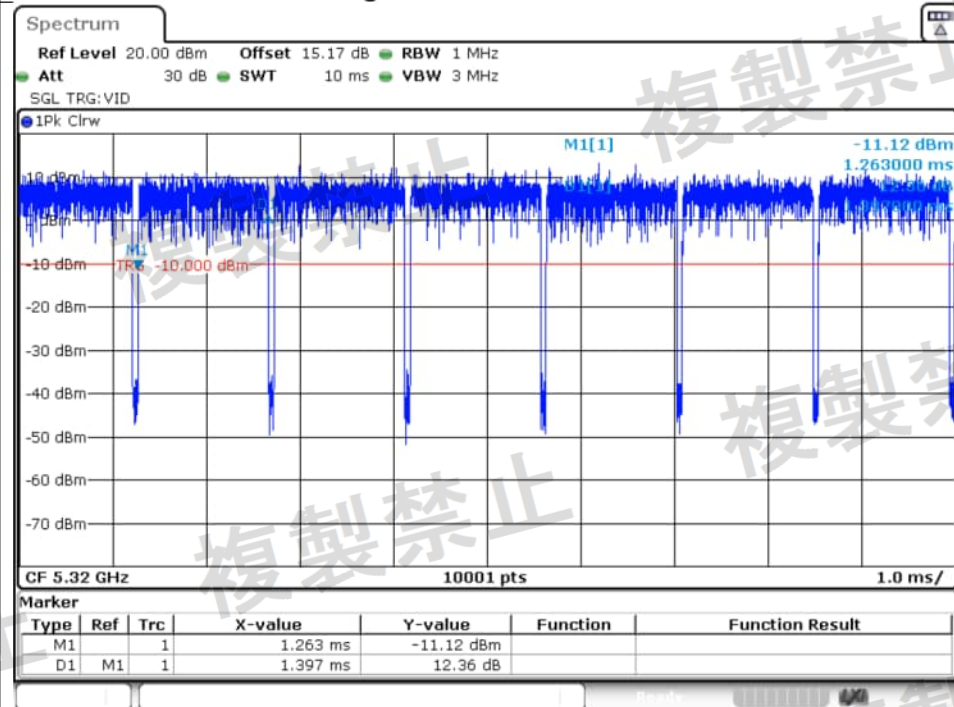




Burst Length NVNT a 5500MHz Ant2

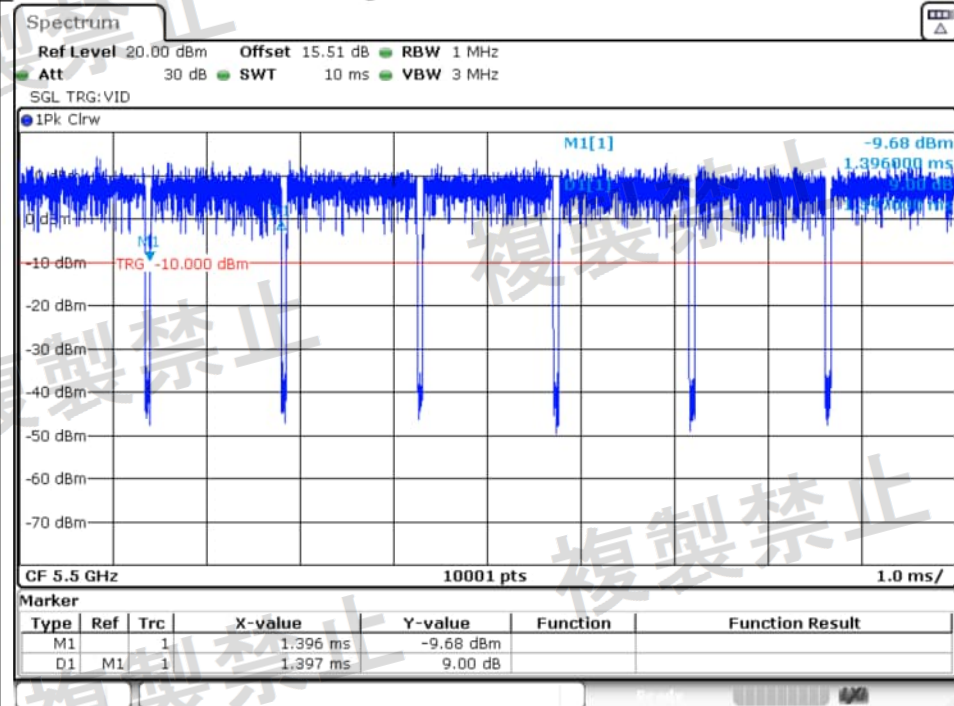



Burst Length NVNT a 5600MHz Ant2

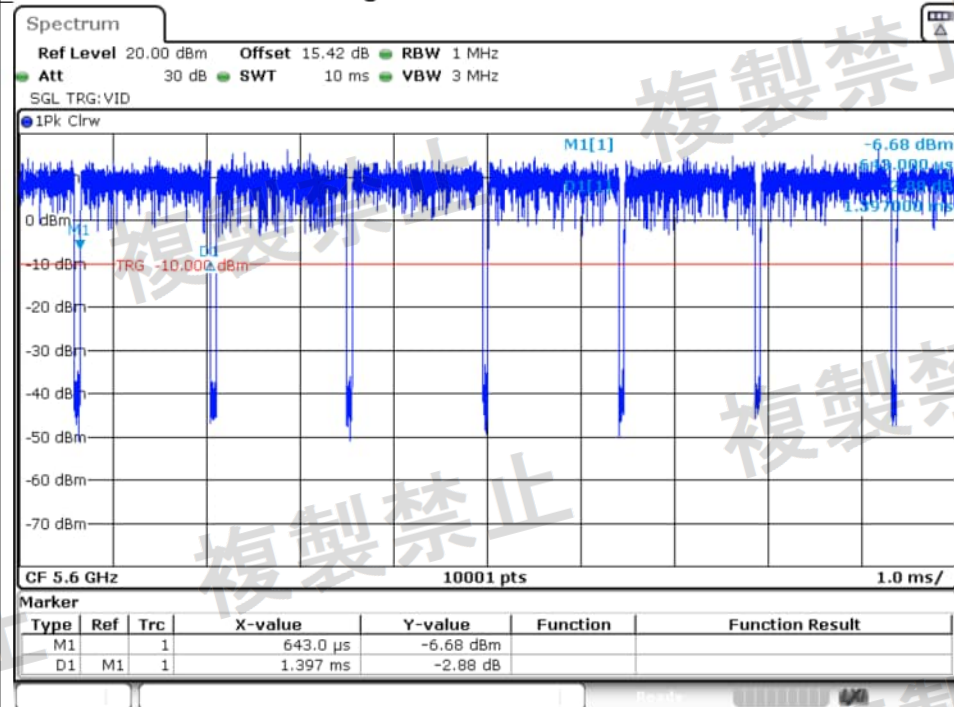


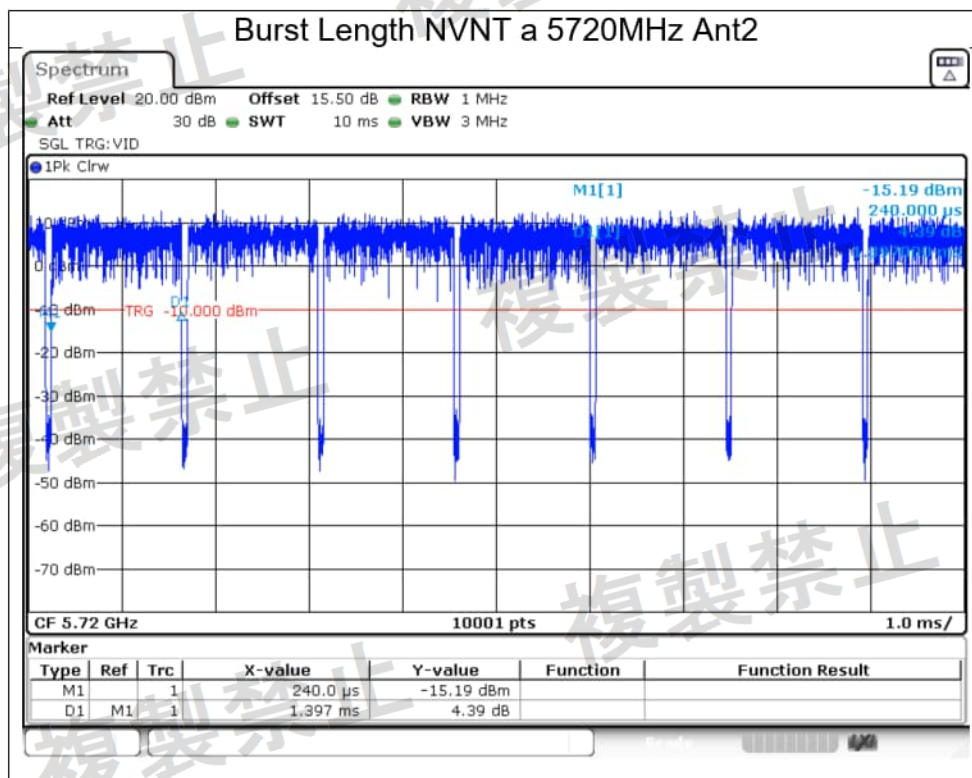


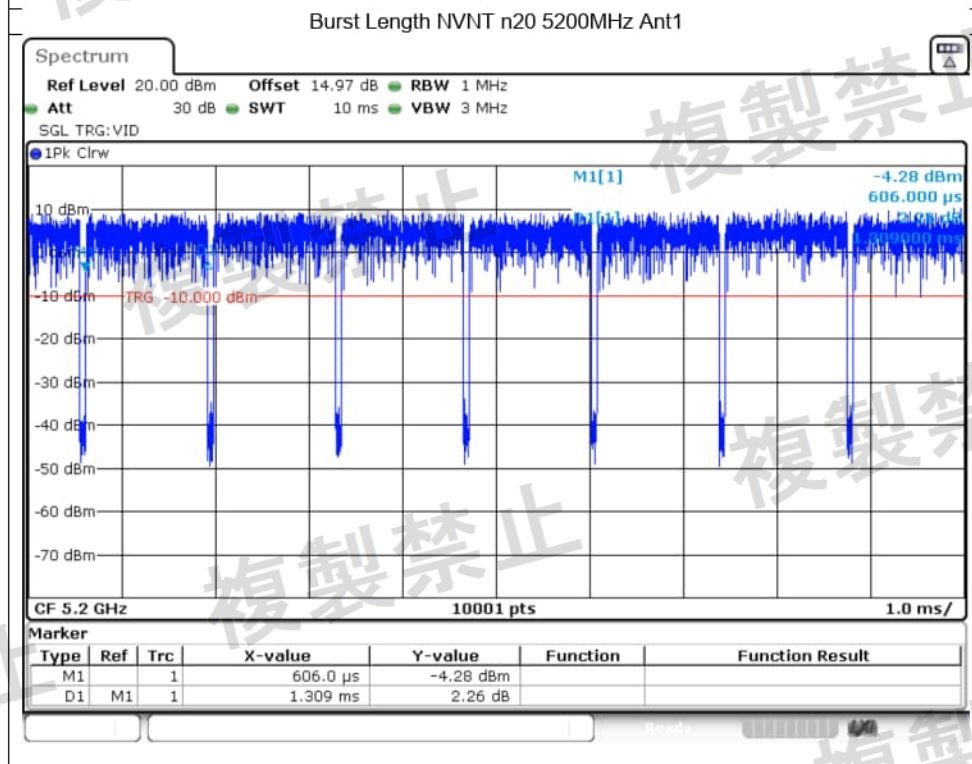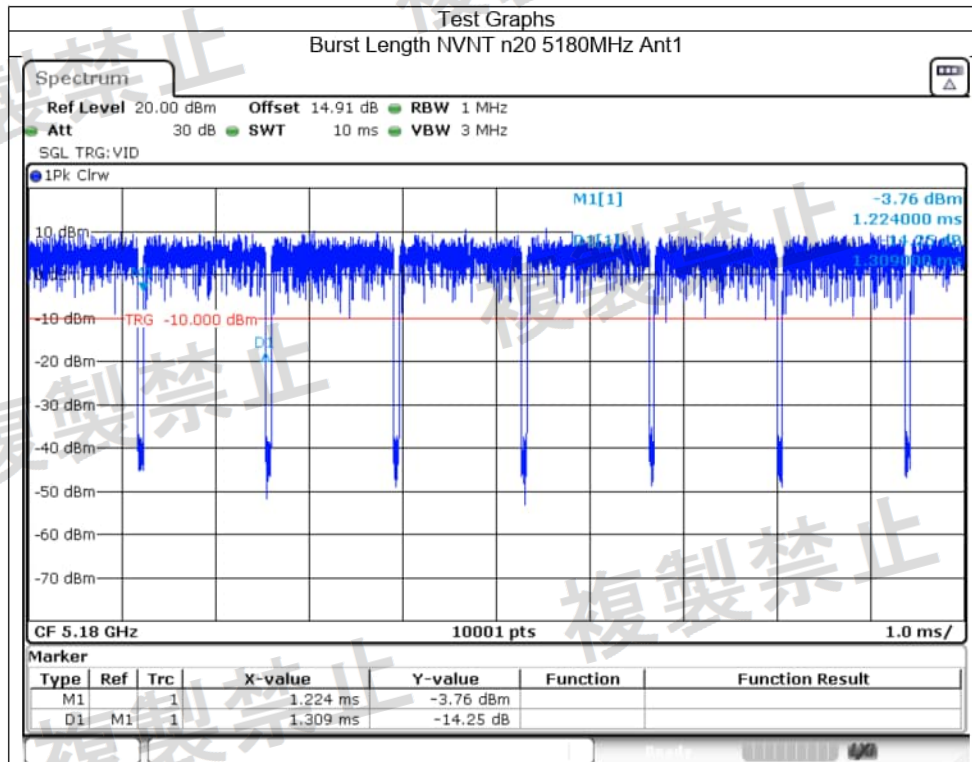


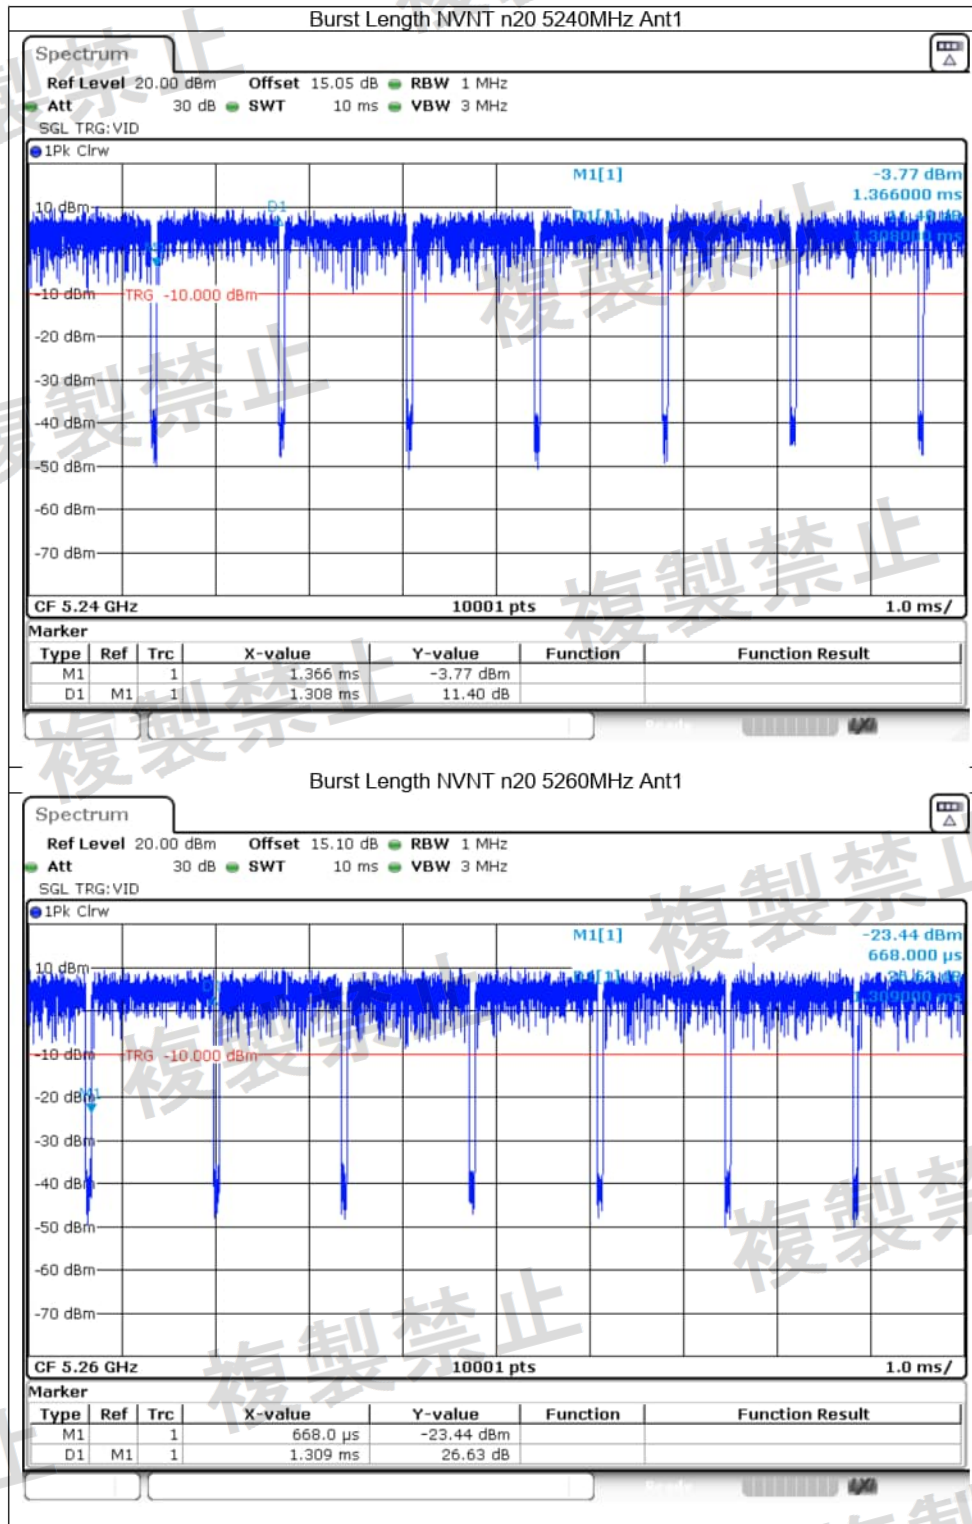


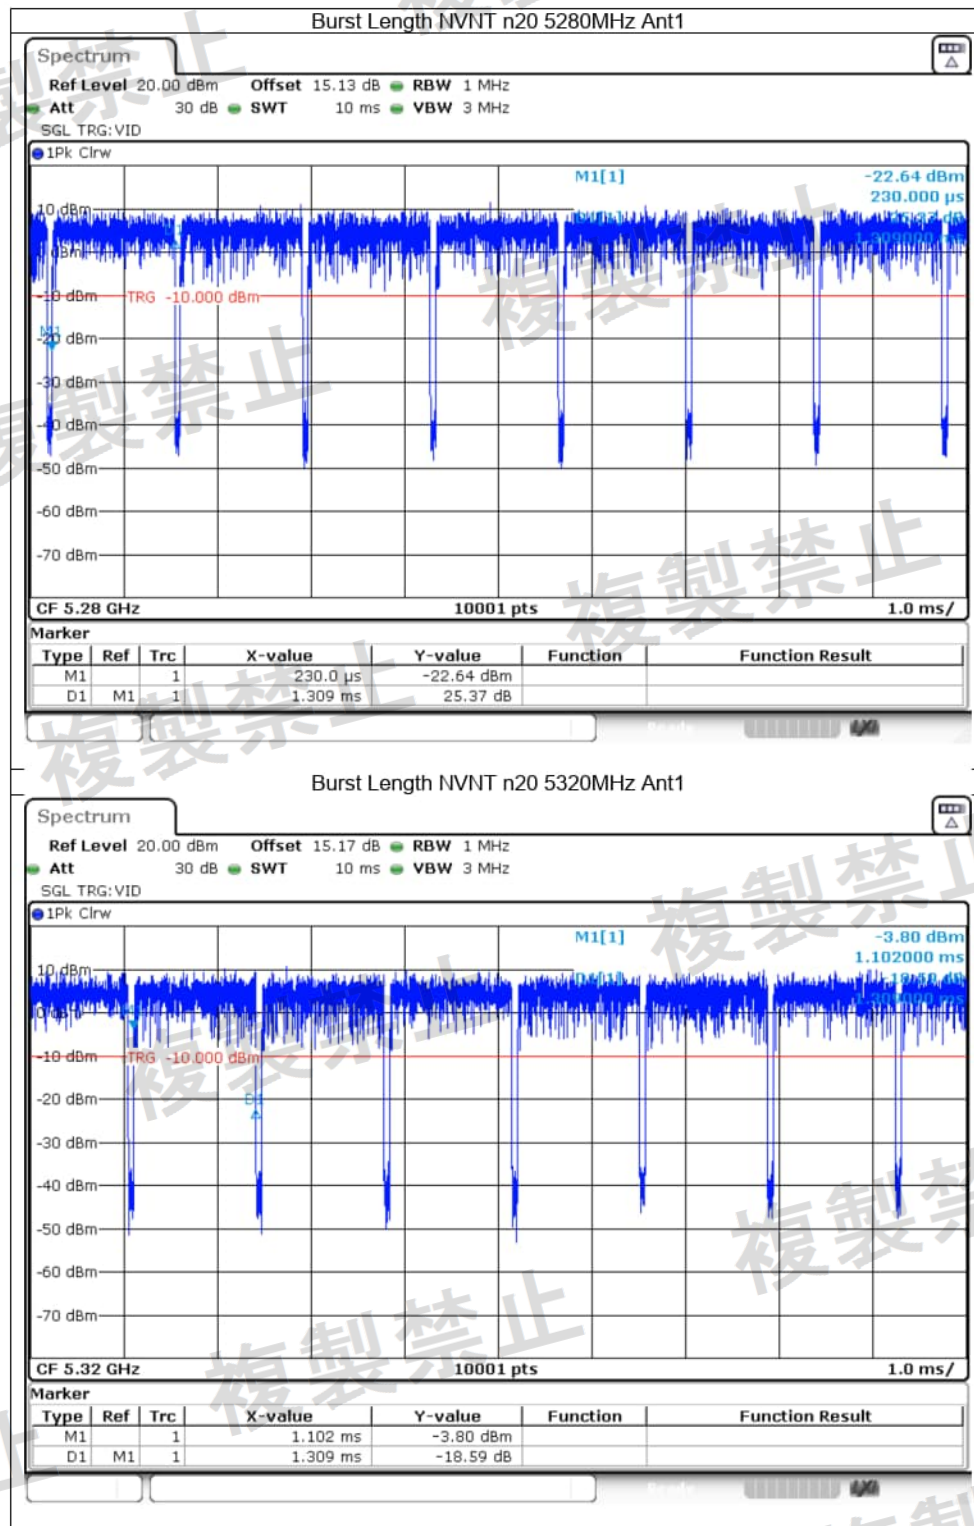


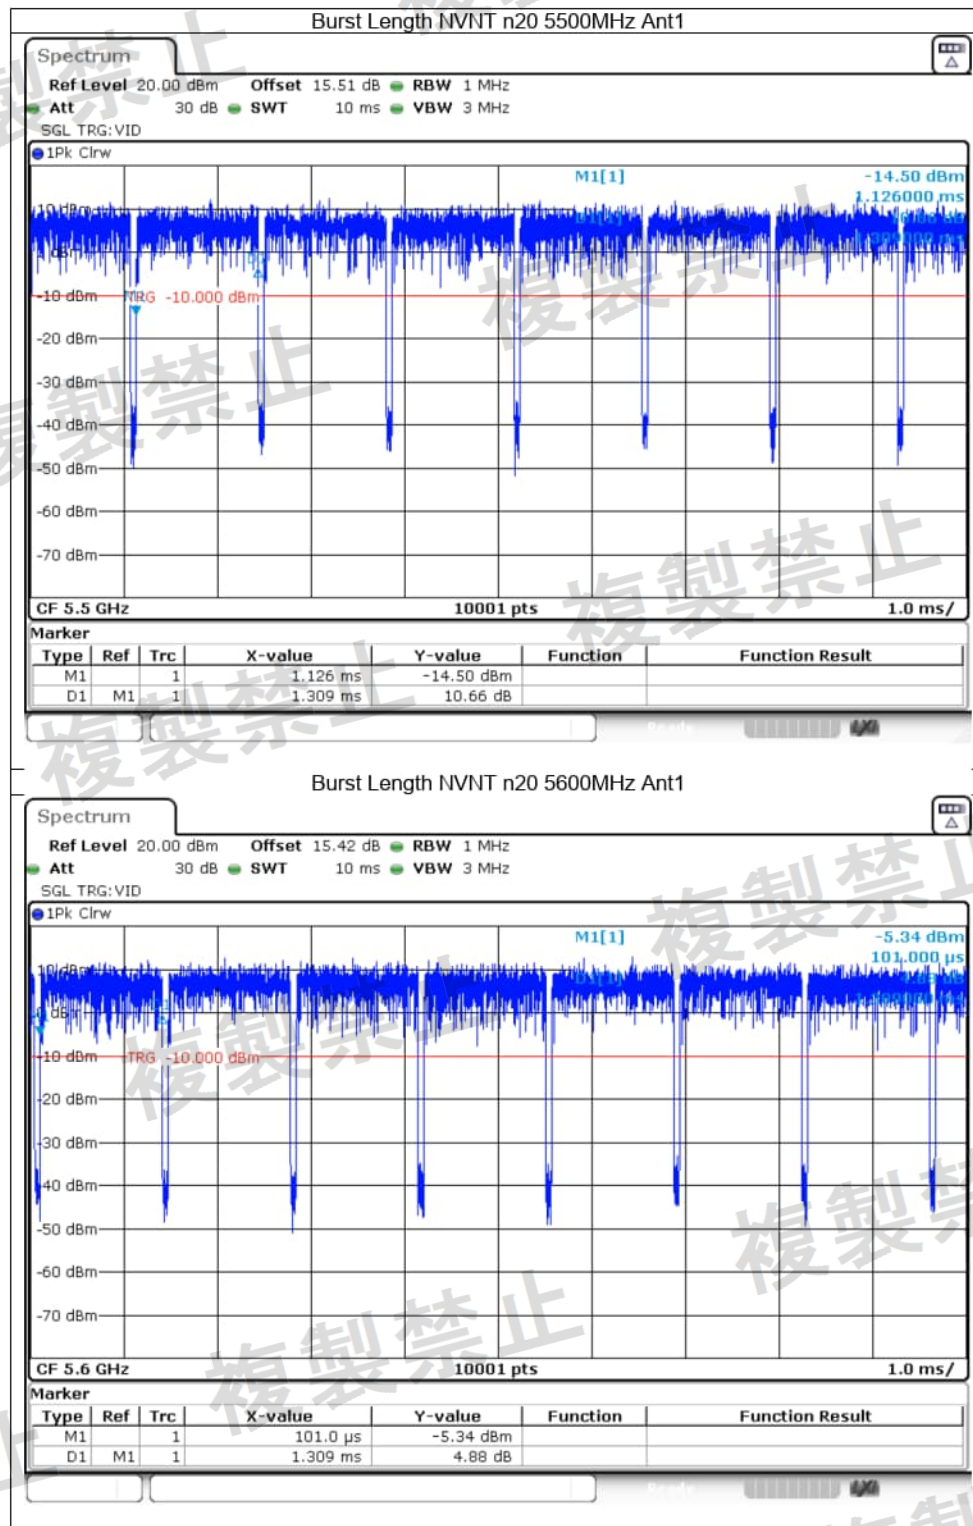

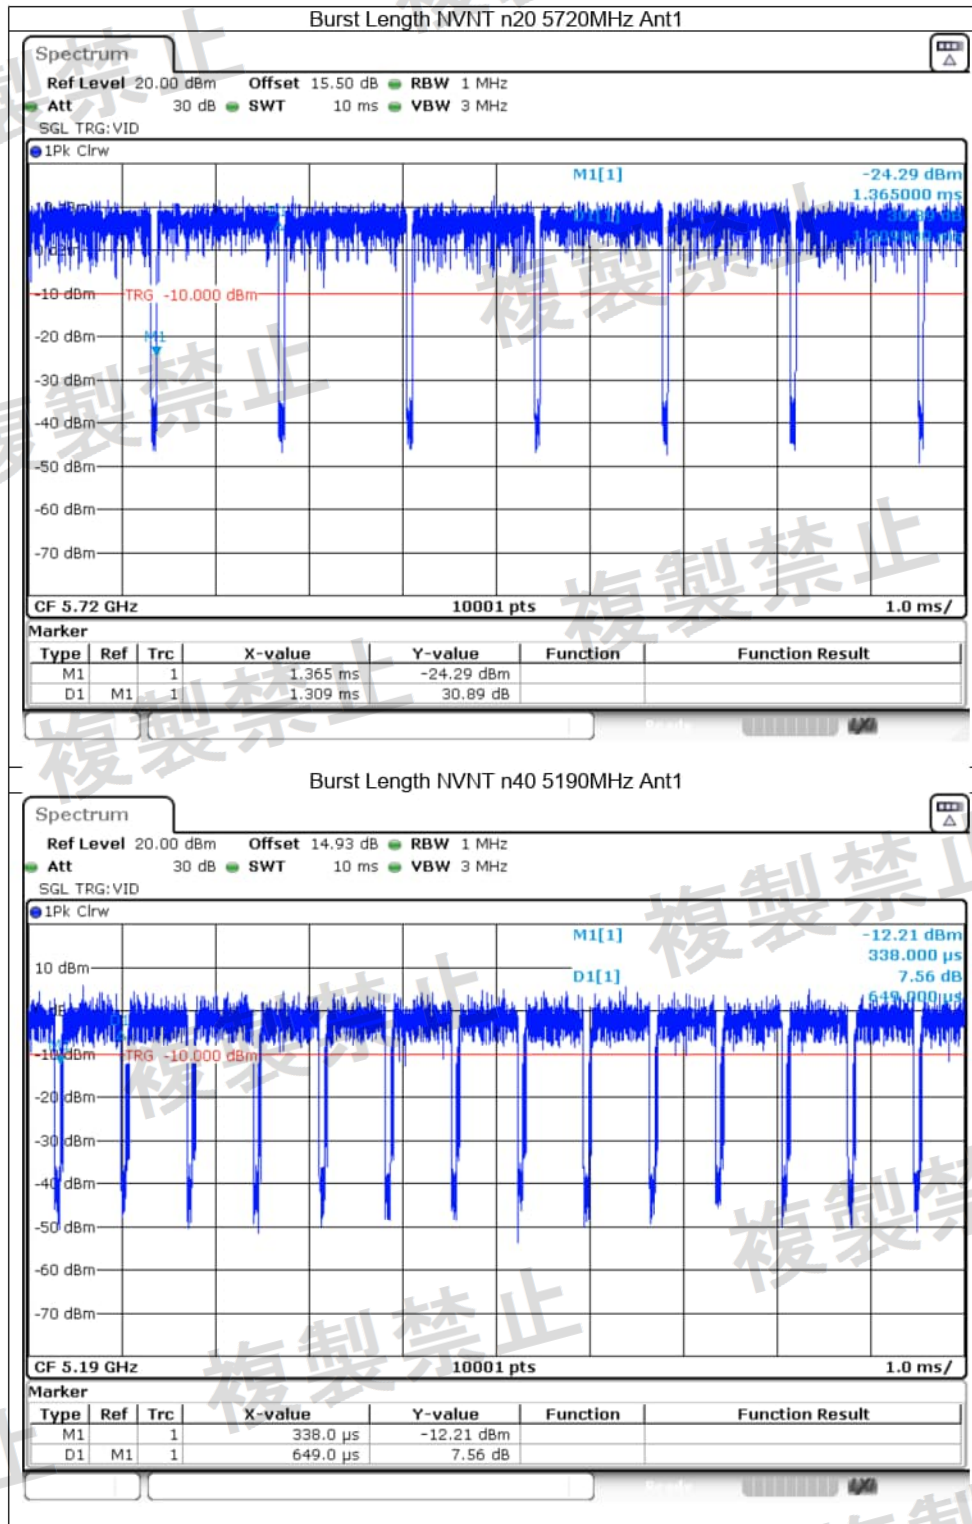


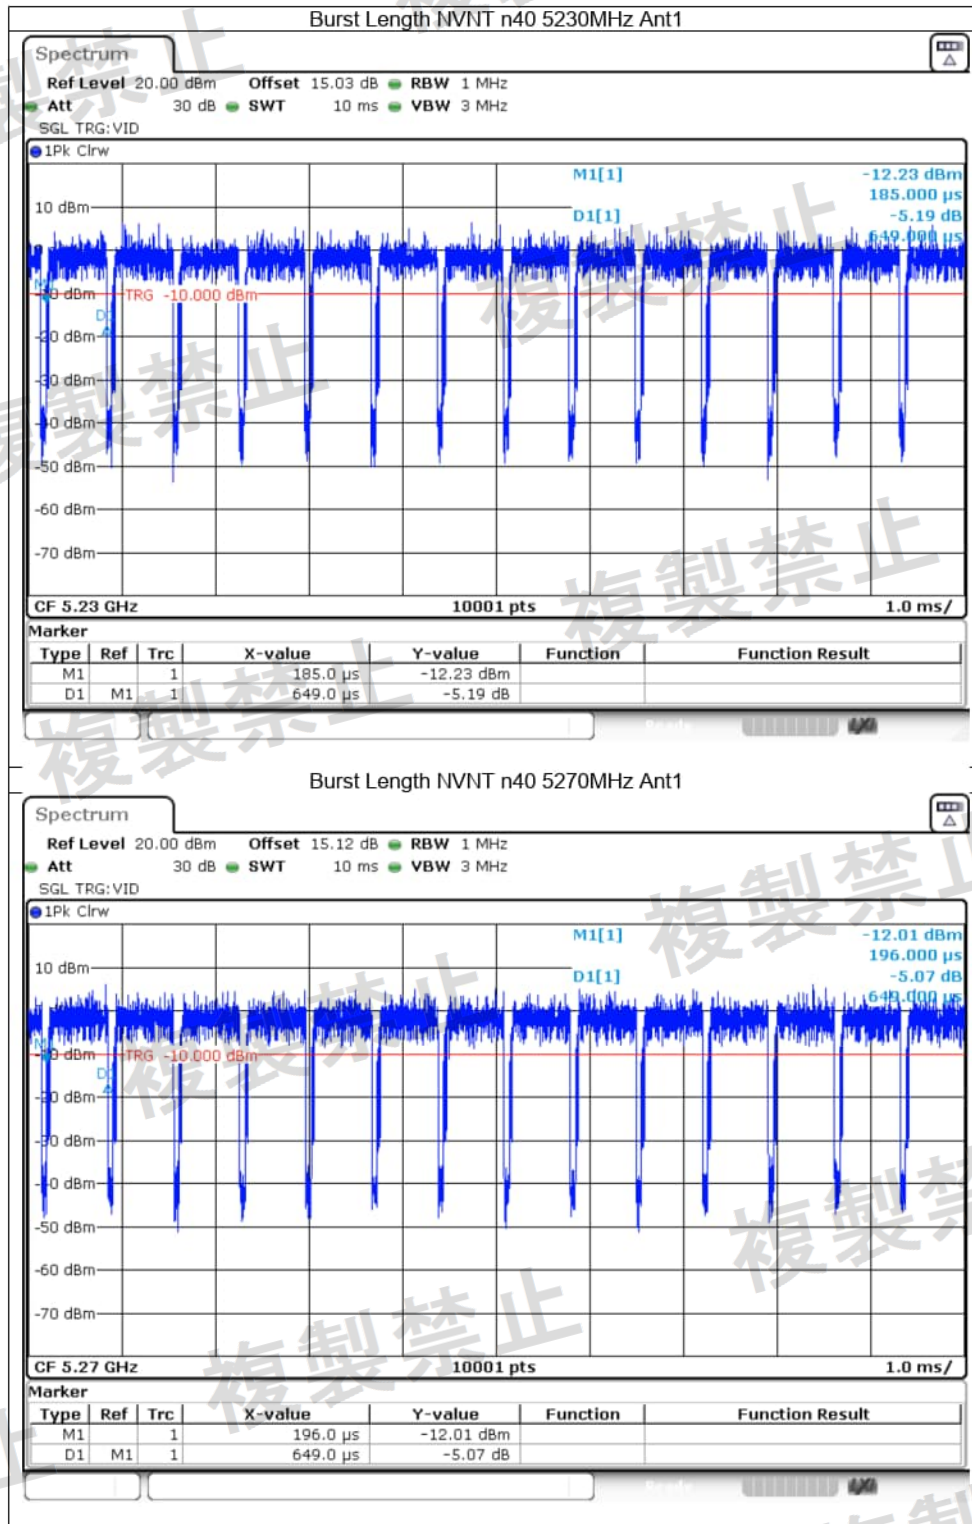

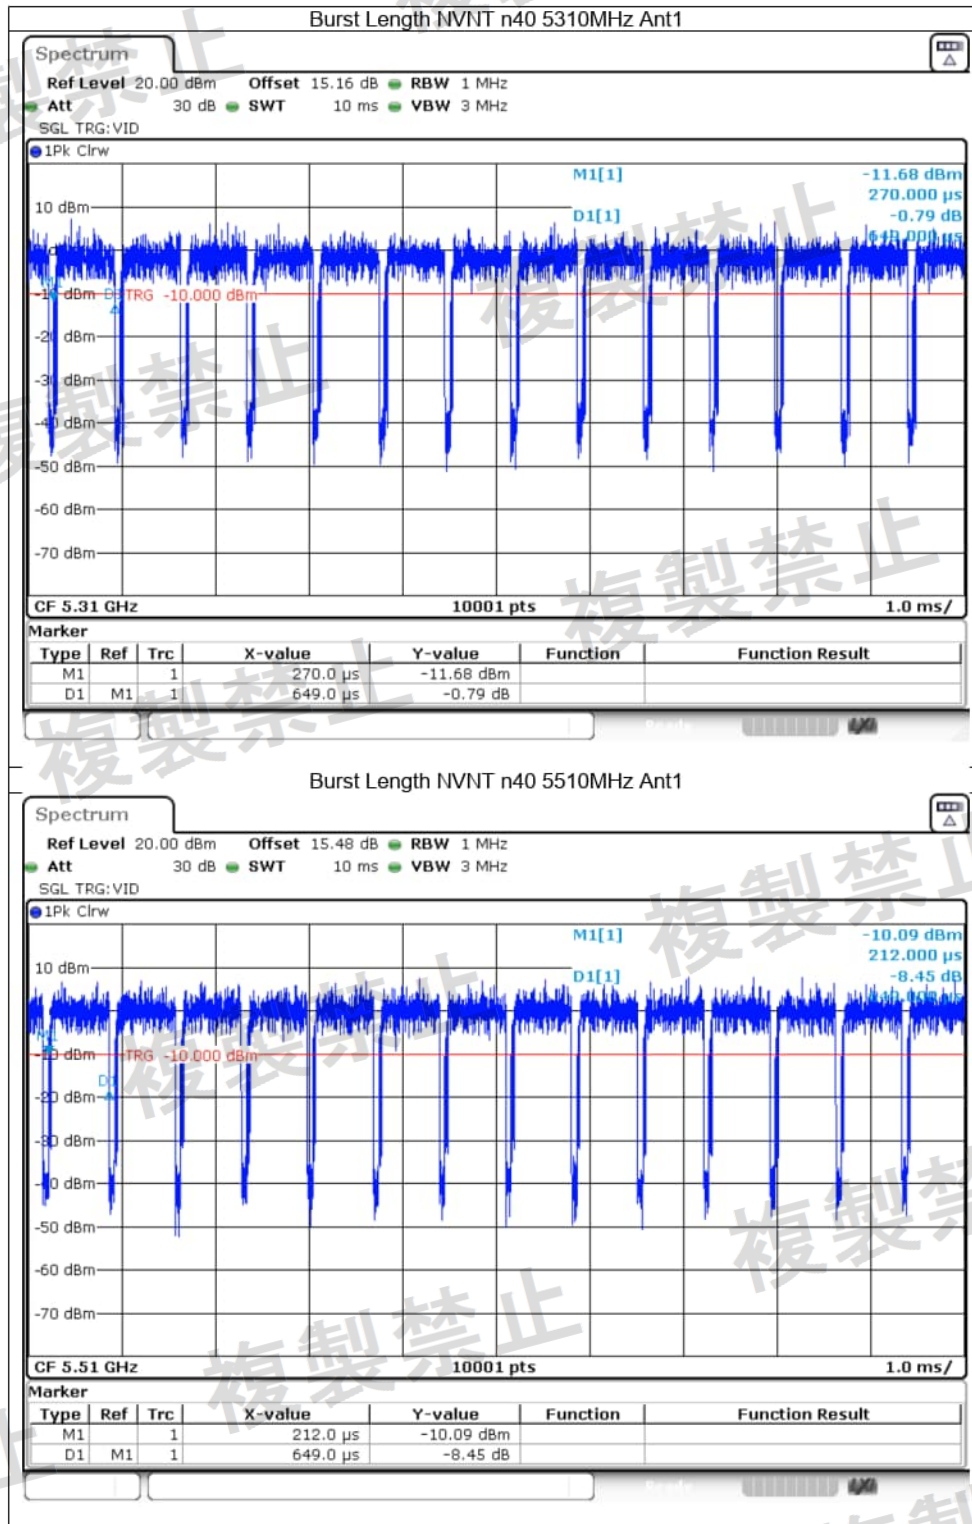


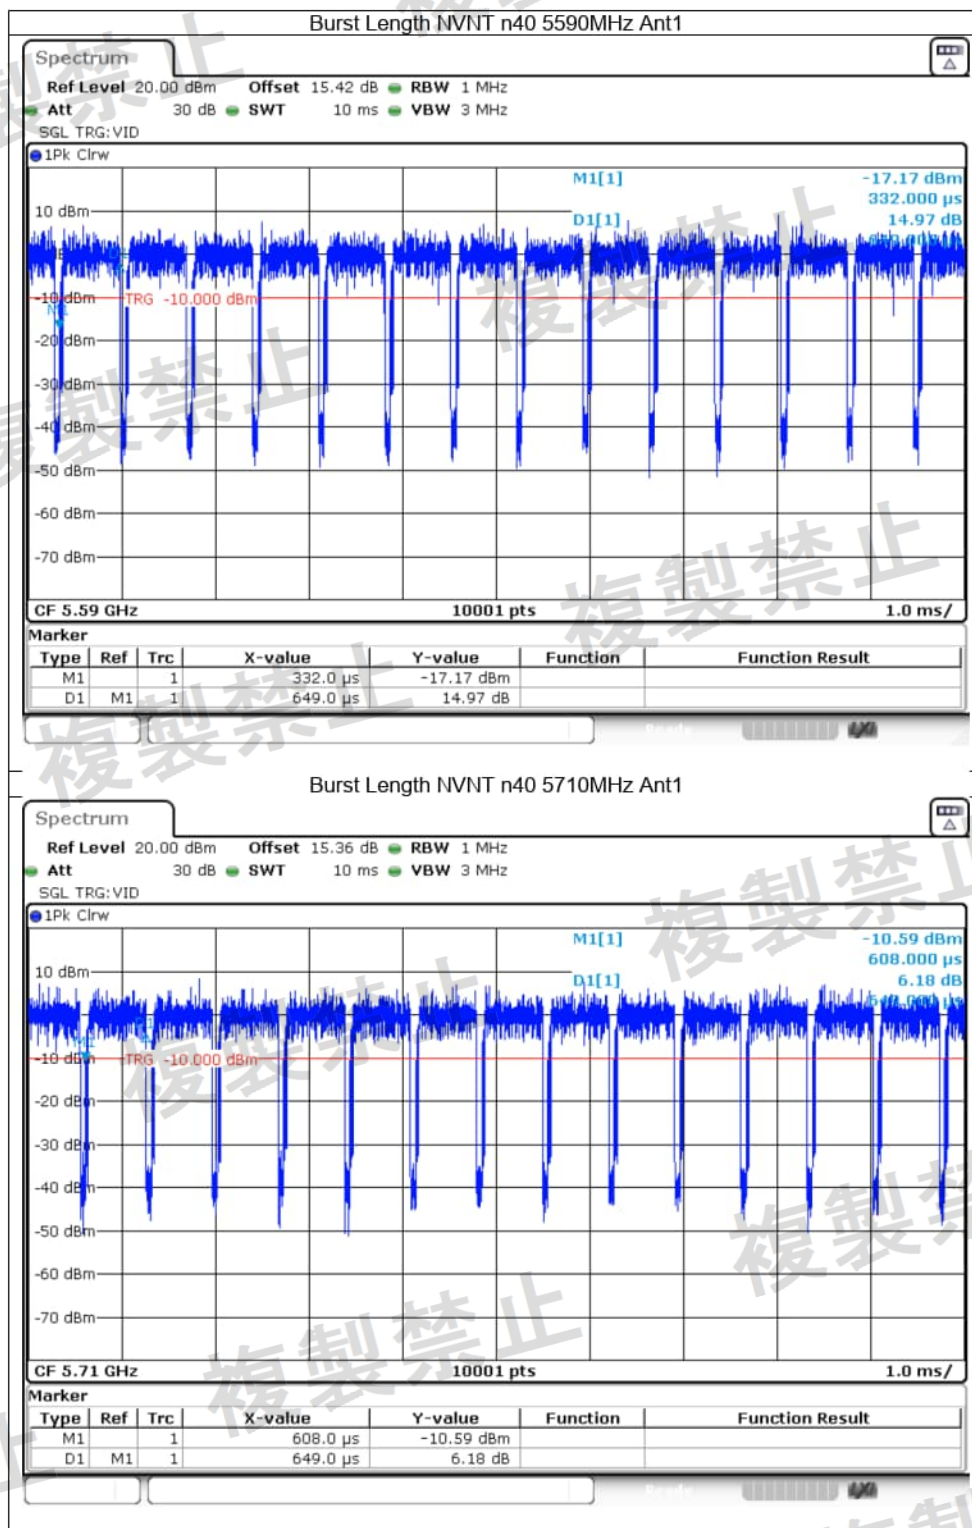

Burst Length NVNT n20 5180MHz Ant2

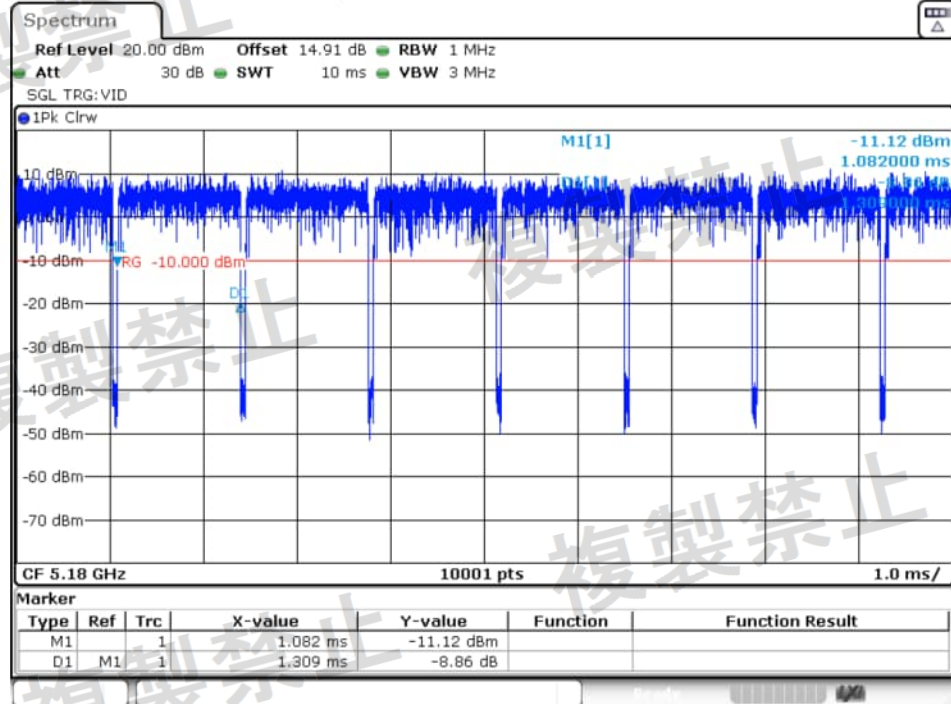


Burst Length NVNT n20 5200MHz Ant2

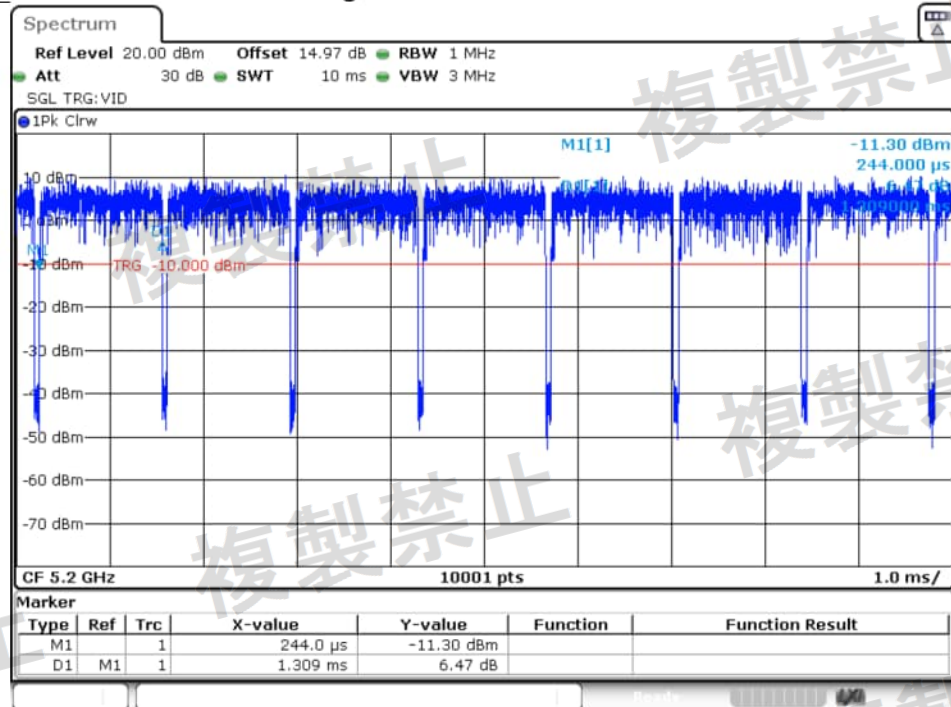





Burst Length NVNT n20 5240MHz Ant2

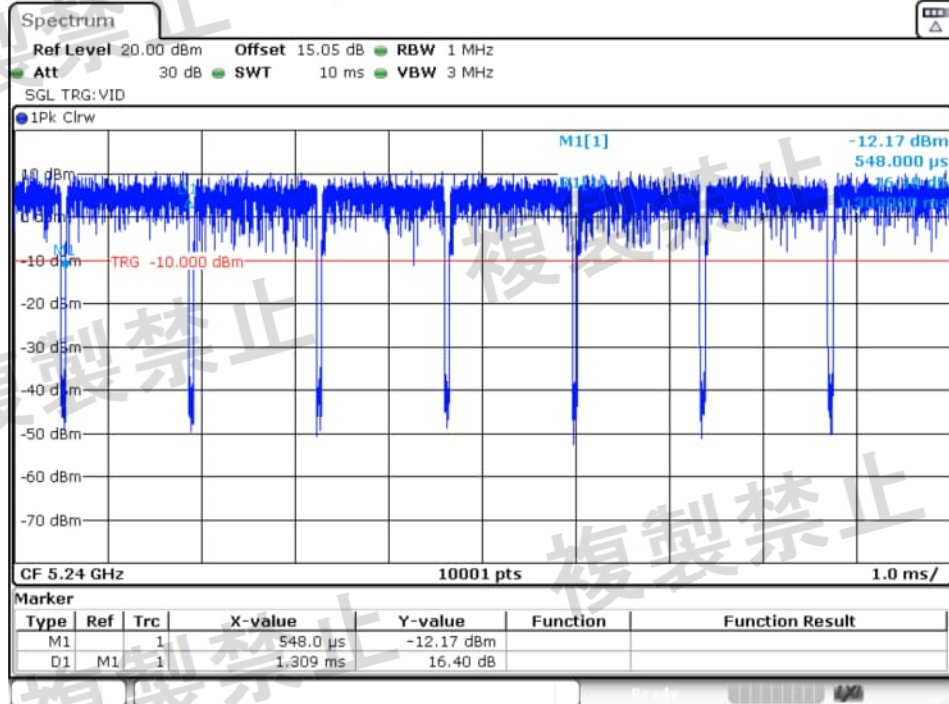


Burst Length NVNT n20 5260MHz Ant2

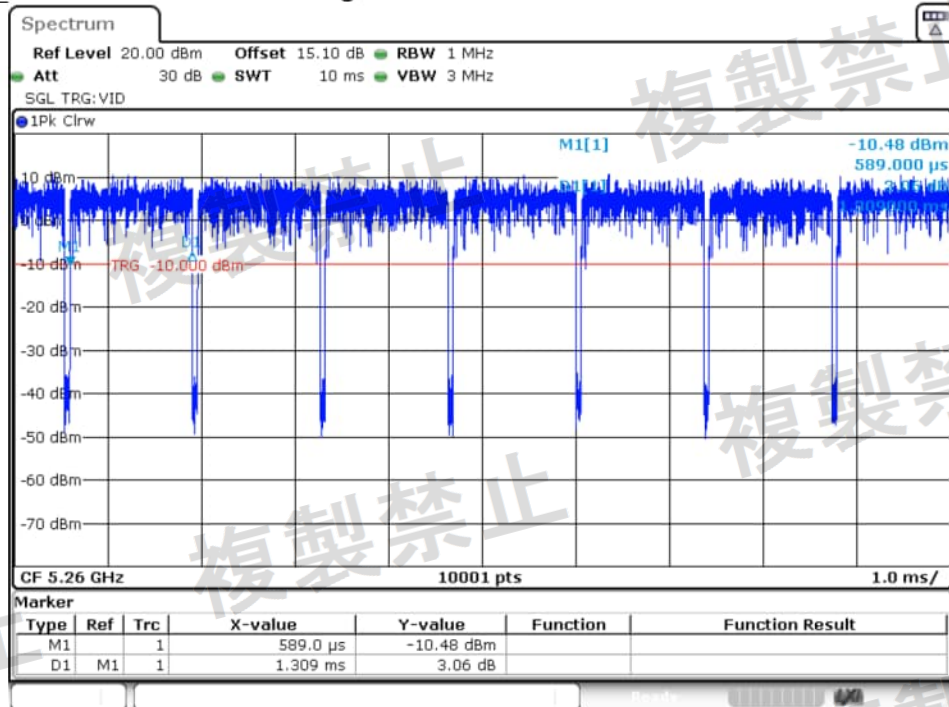


Burst Length NVNT n20 5280MHz Ant2

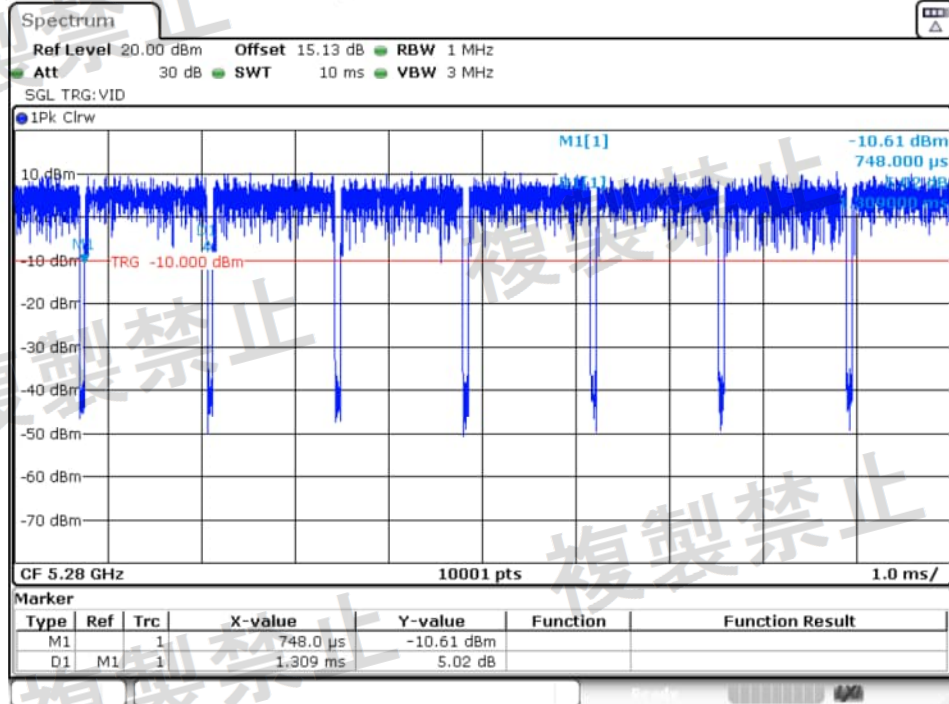


Burst Length NVNT n20 5320MHz Ant2

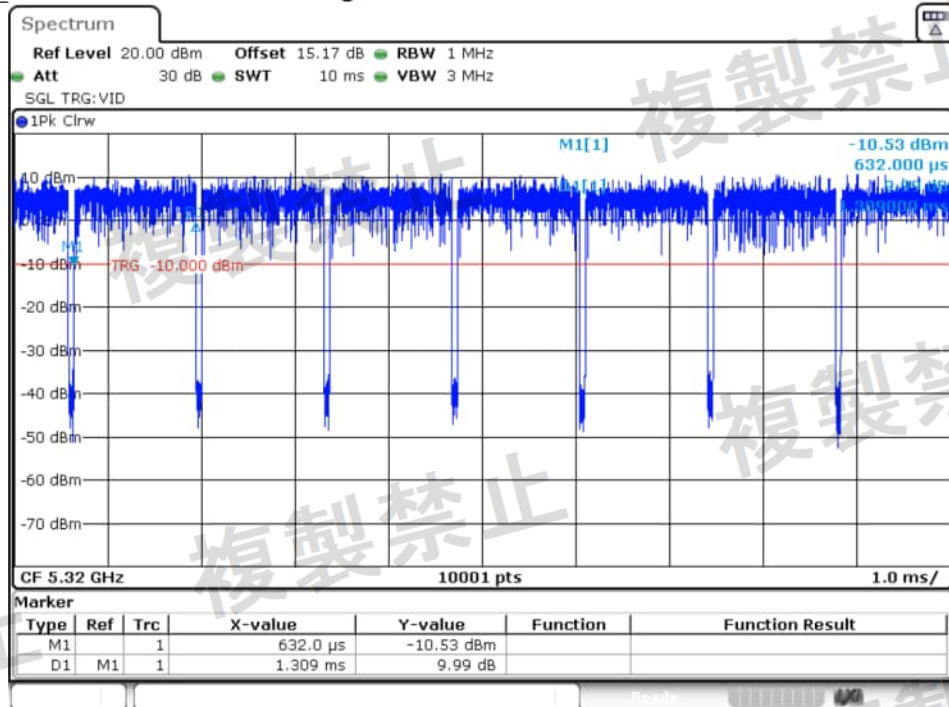

Burst Length NVNT n20 5500MHz Ant2

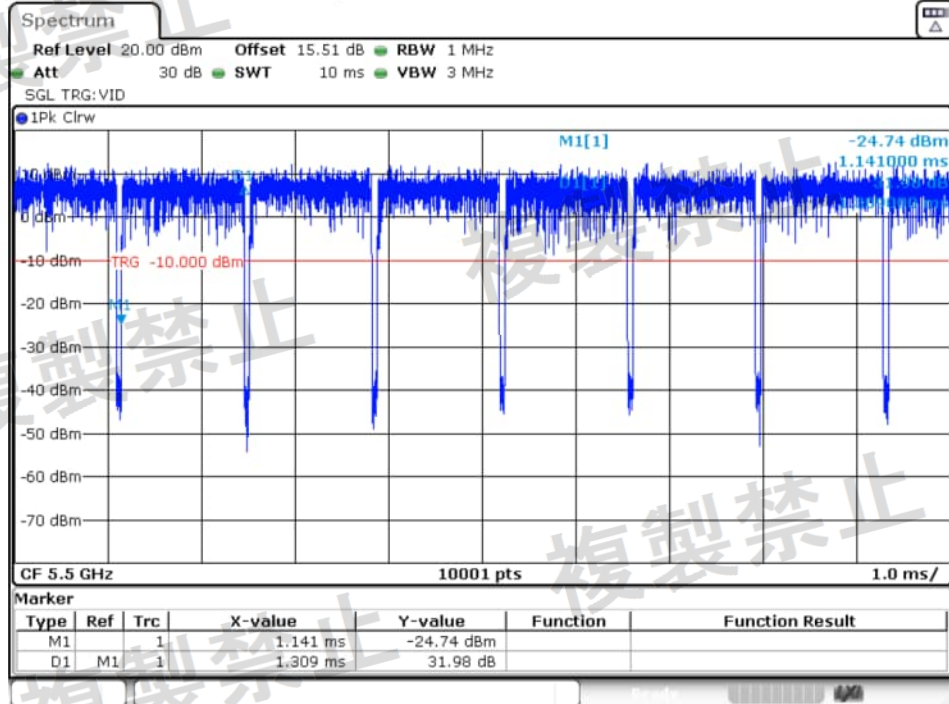


Burst Length NVNT n20 5600MHz Ant2

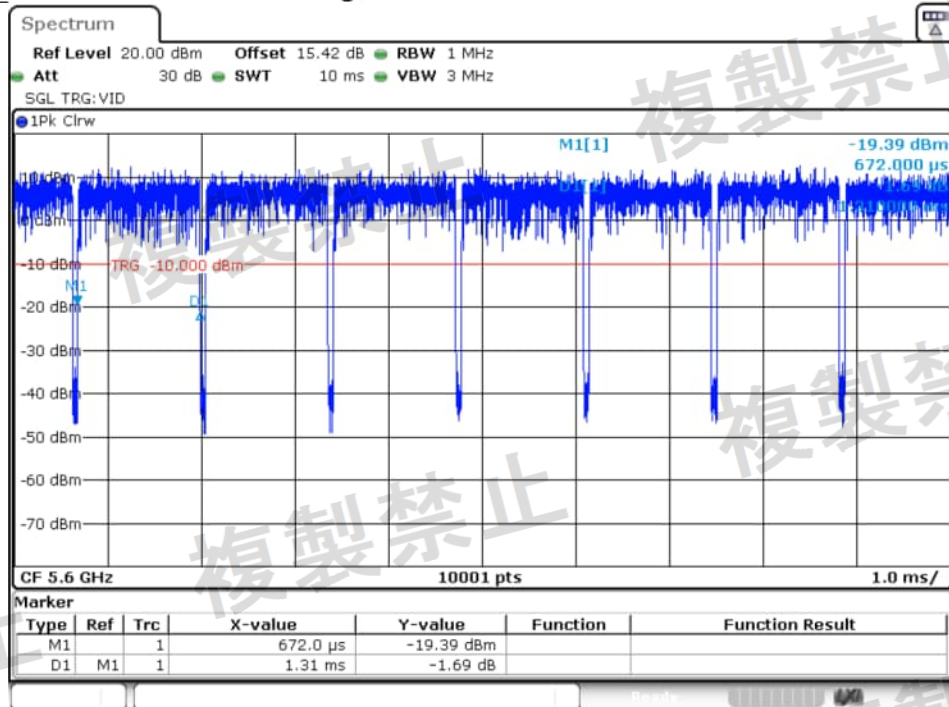





Burst Length NVNT n20 5720MHz Ant2

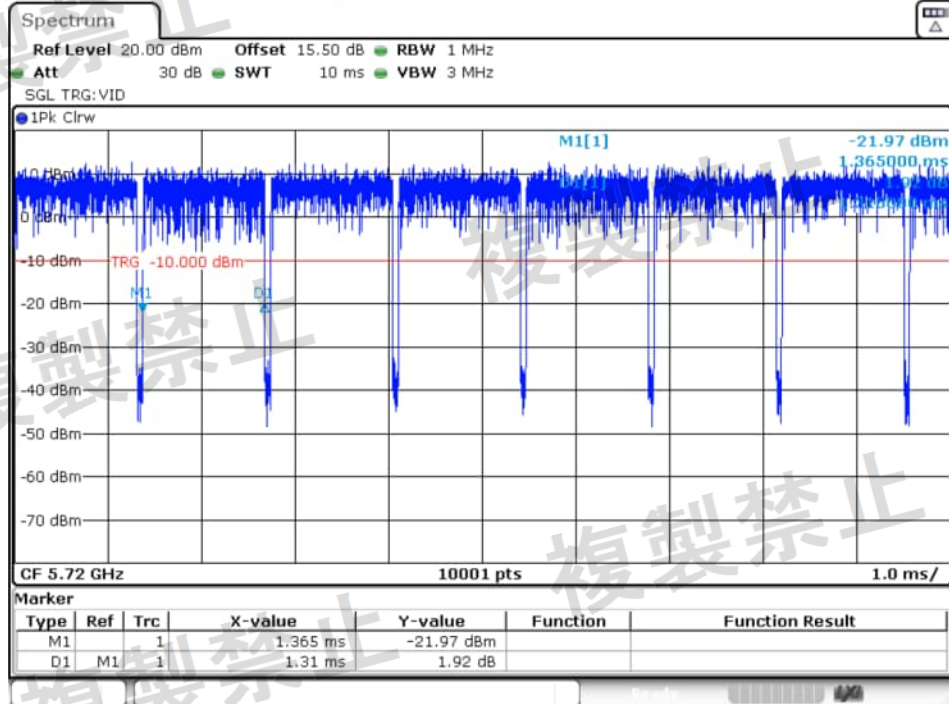


Burst Length NVNT n40 5190MHz Ant2

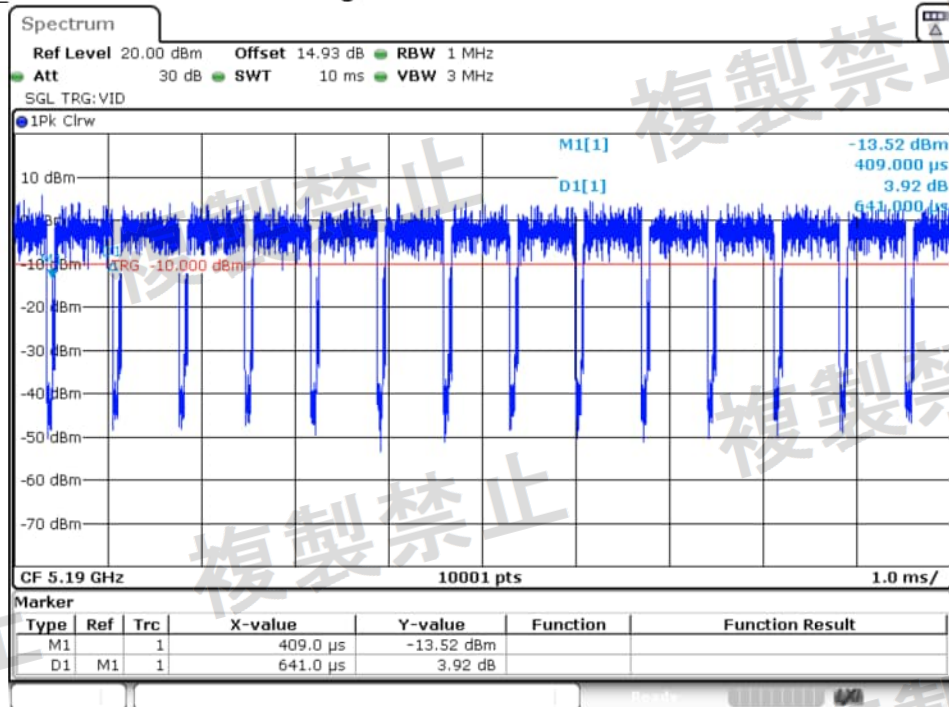


Burst Length NVNT n40 5230MHz Ant2

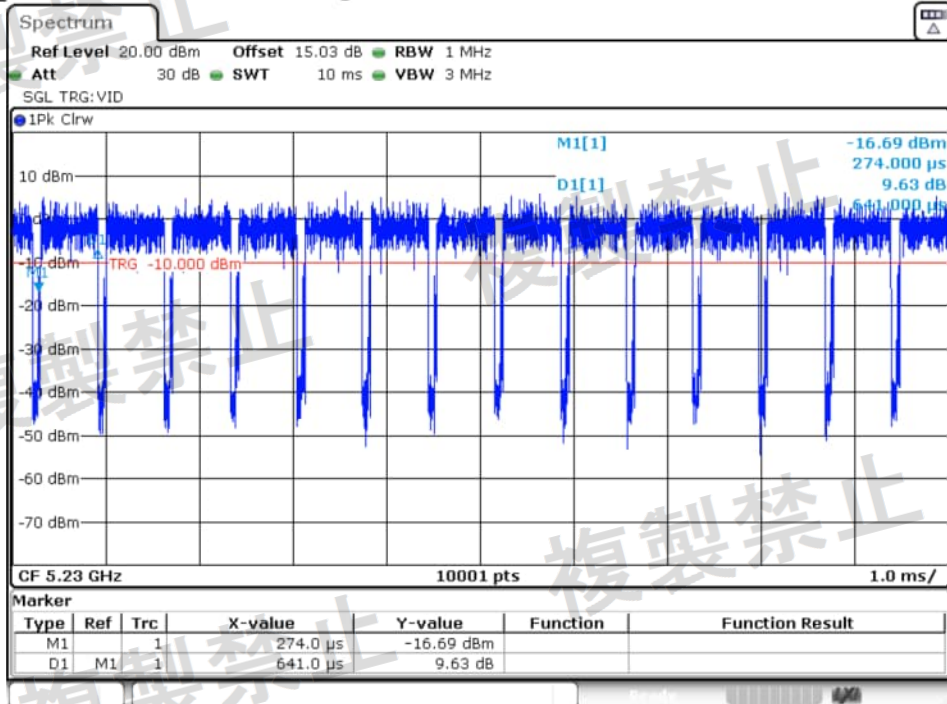


Burst Length NVNT n40 5270MHz Ant2

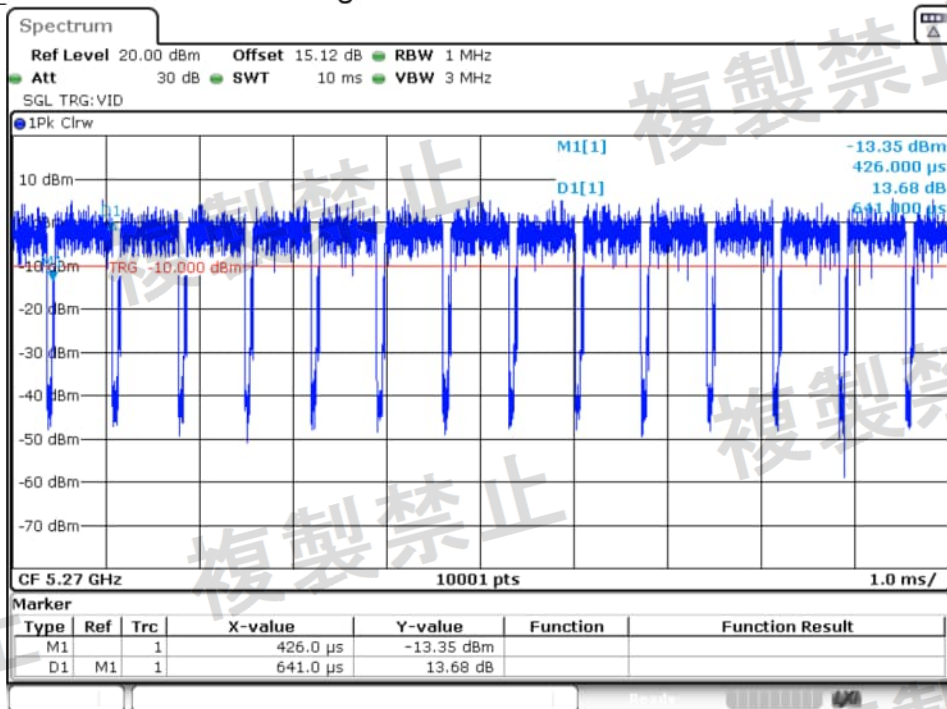


Burst Length NVNT n40 5310MHz Ant2

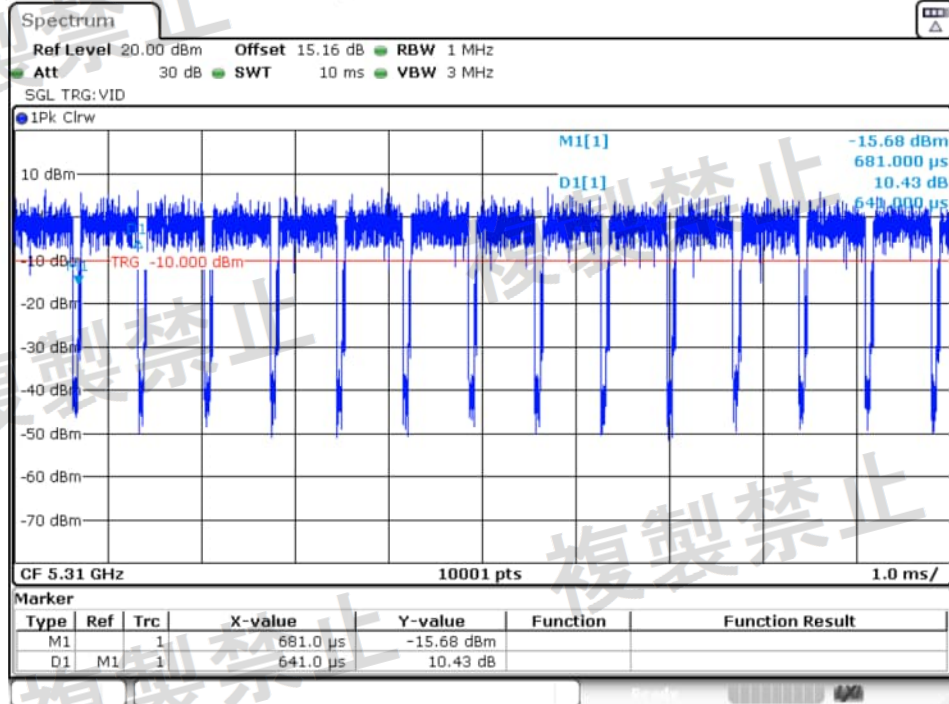


Burst Length NVNT n40 5510MHz Ant2


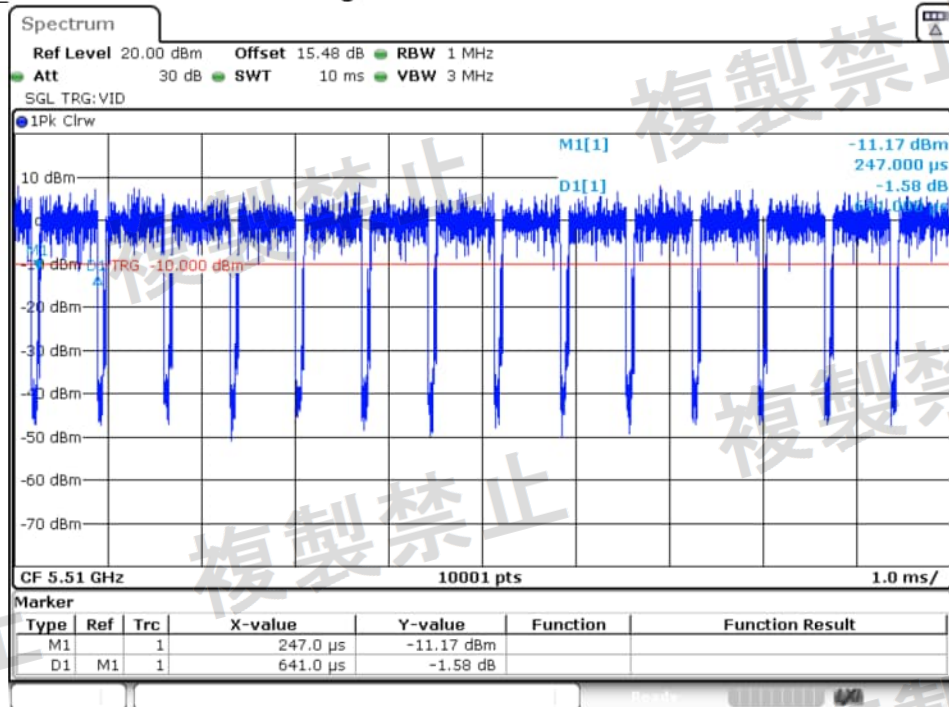



Burst Length NVNT n40 5590MHz Ant2


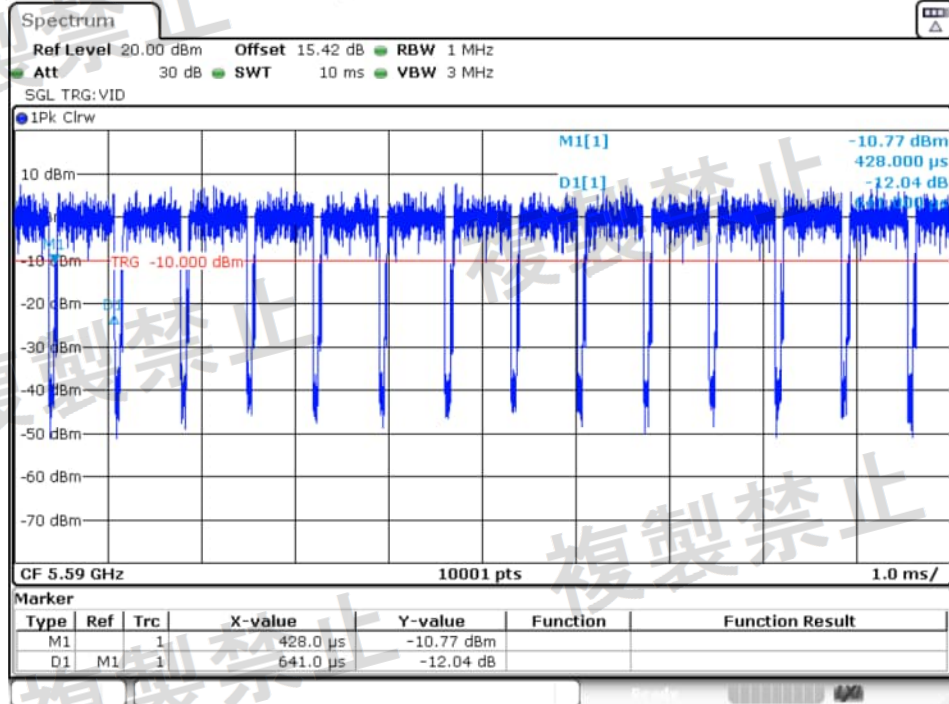



Burst Length NVNT n40 5710MHz Ant2

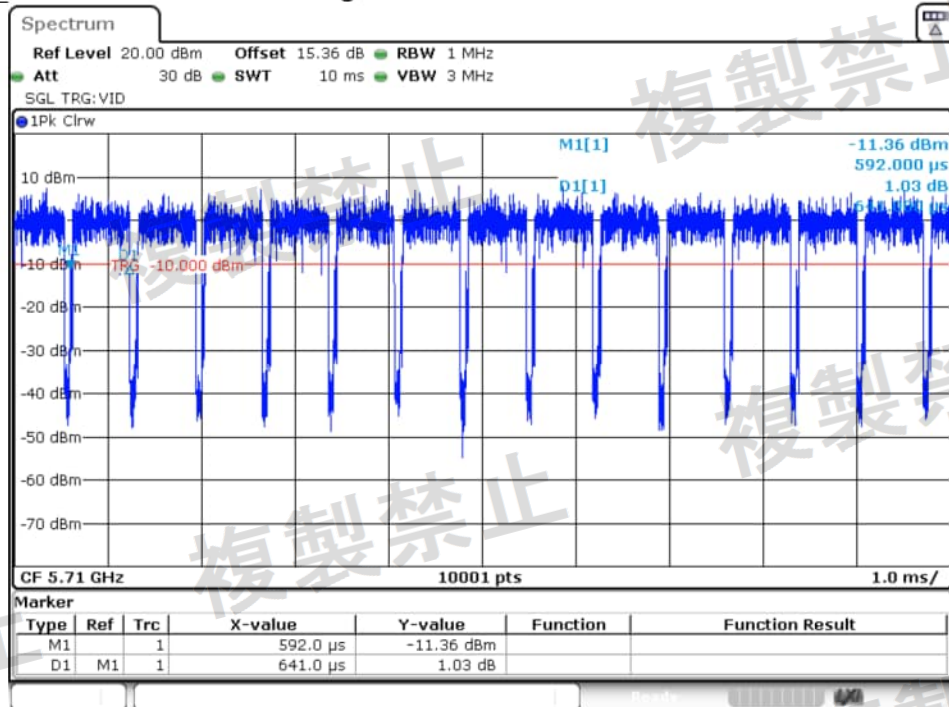


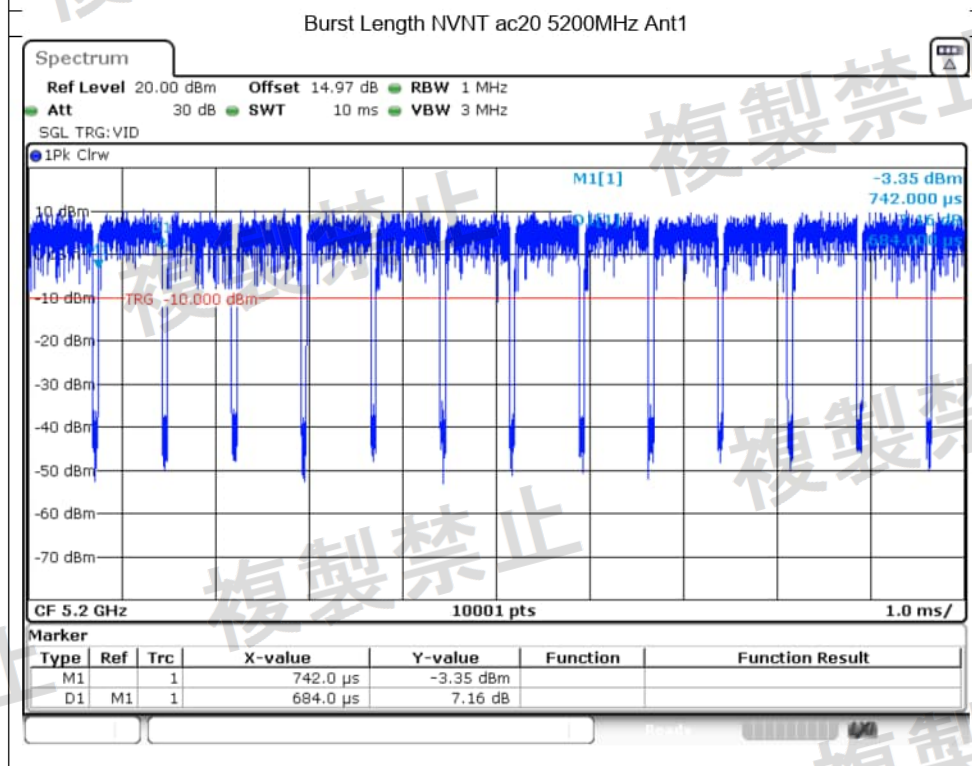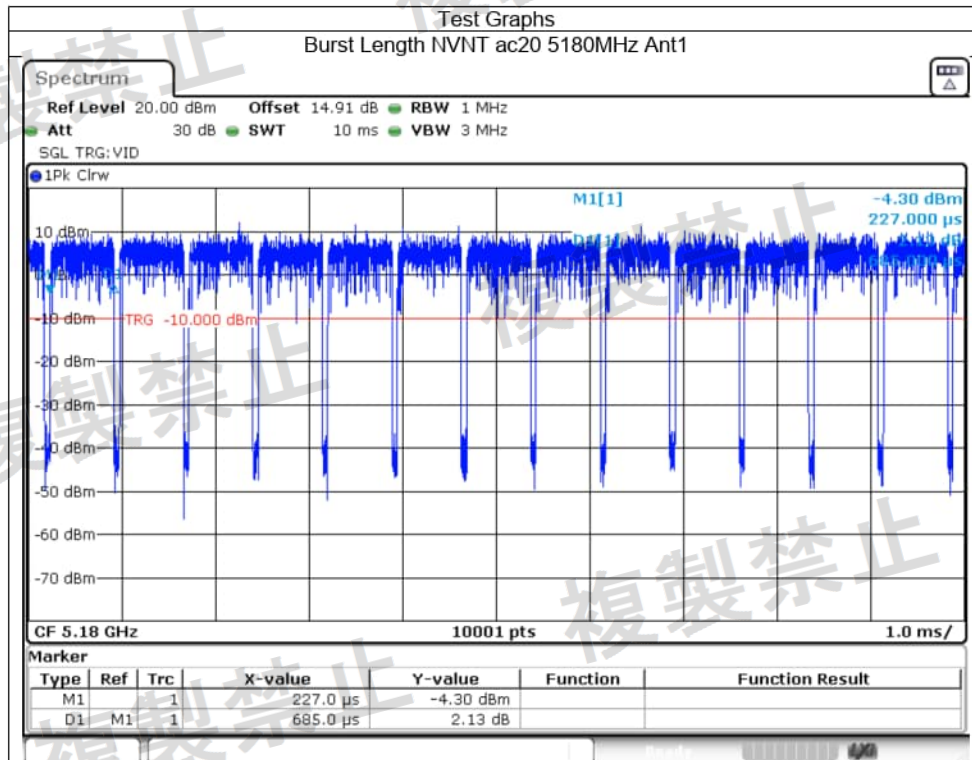



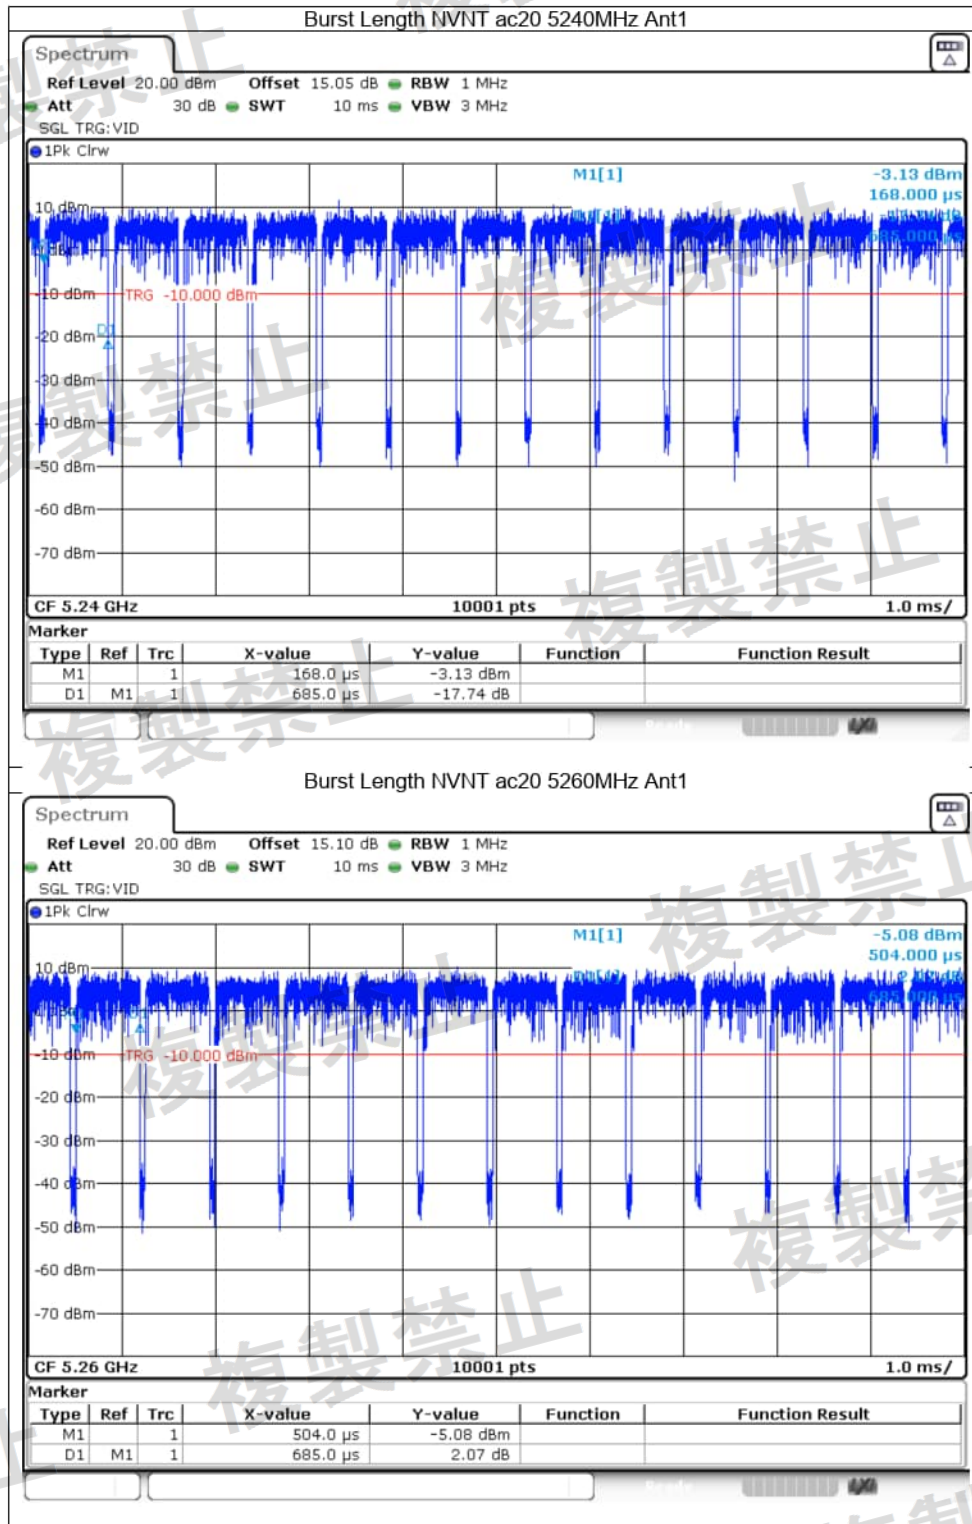


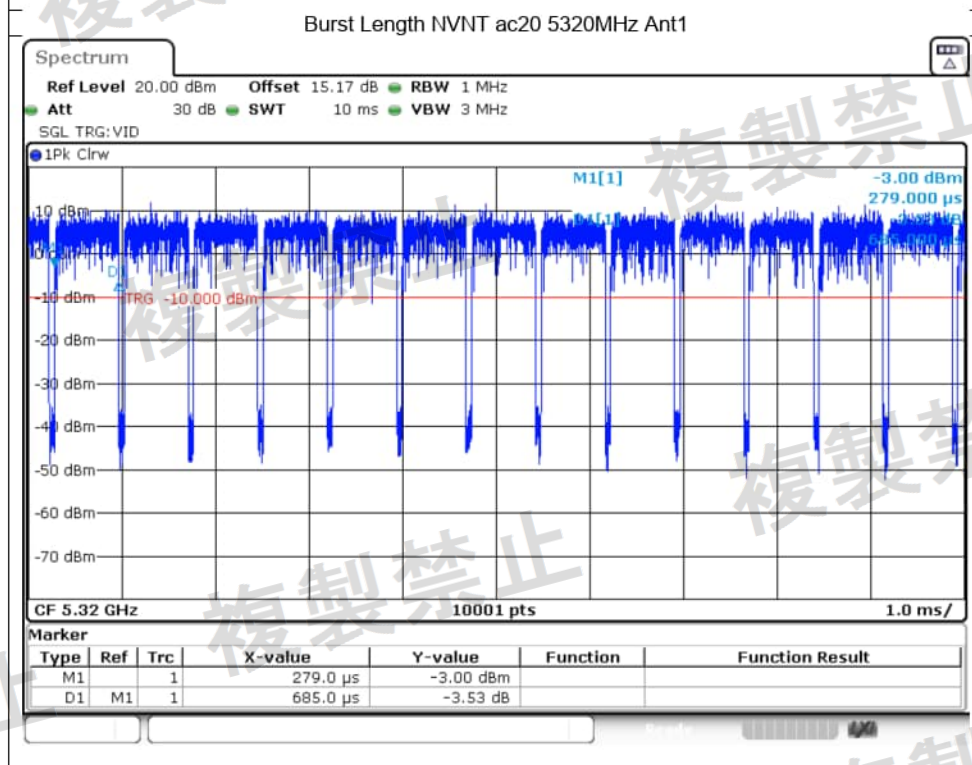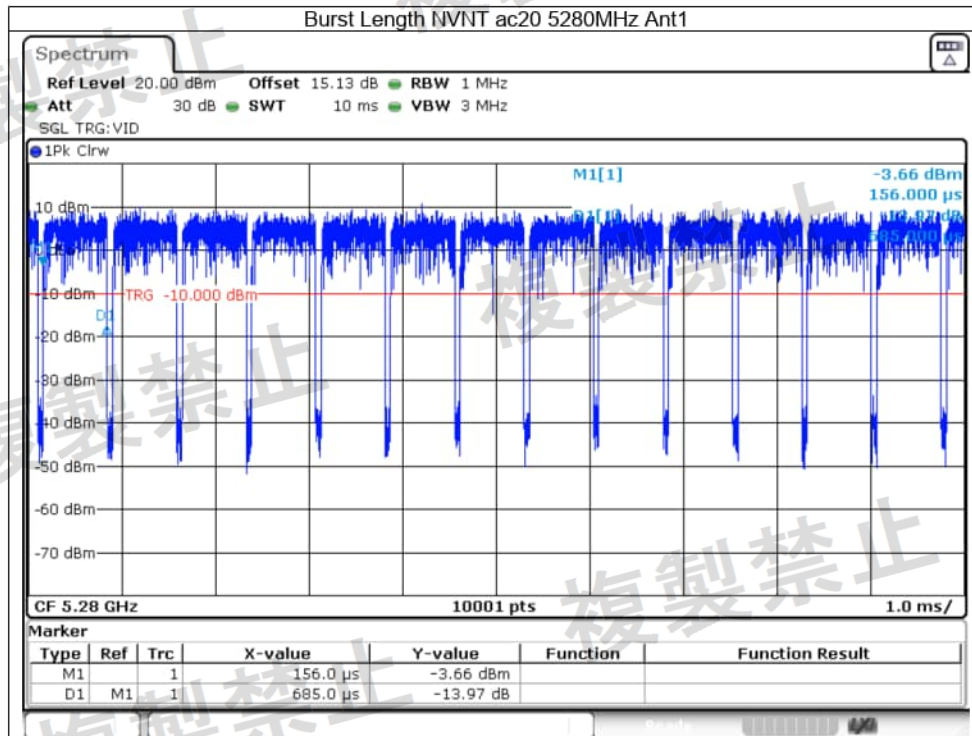



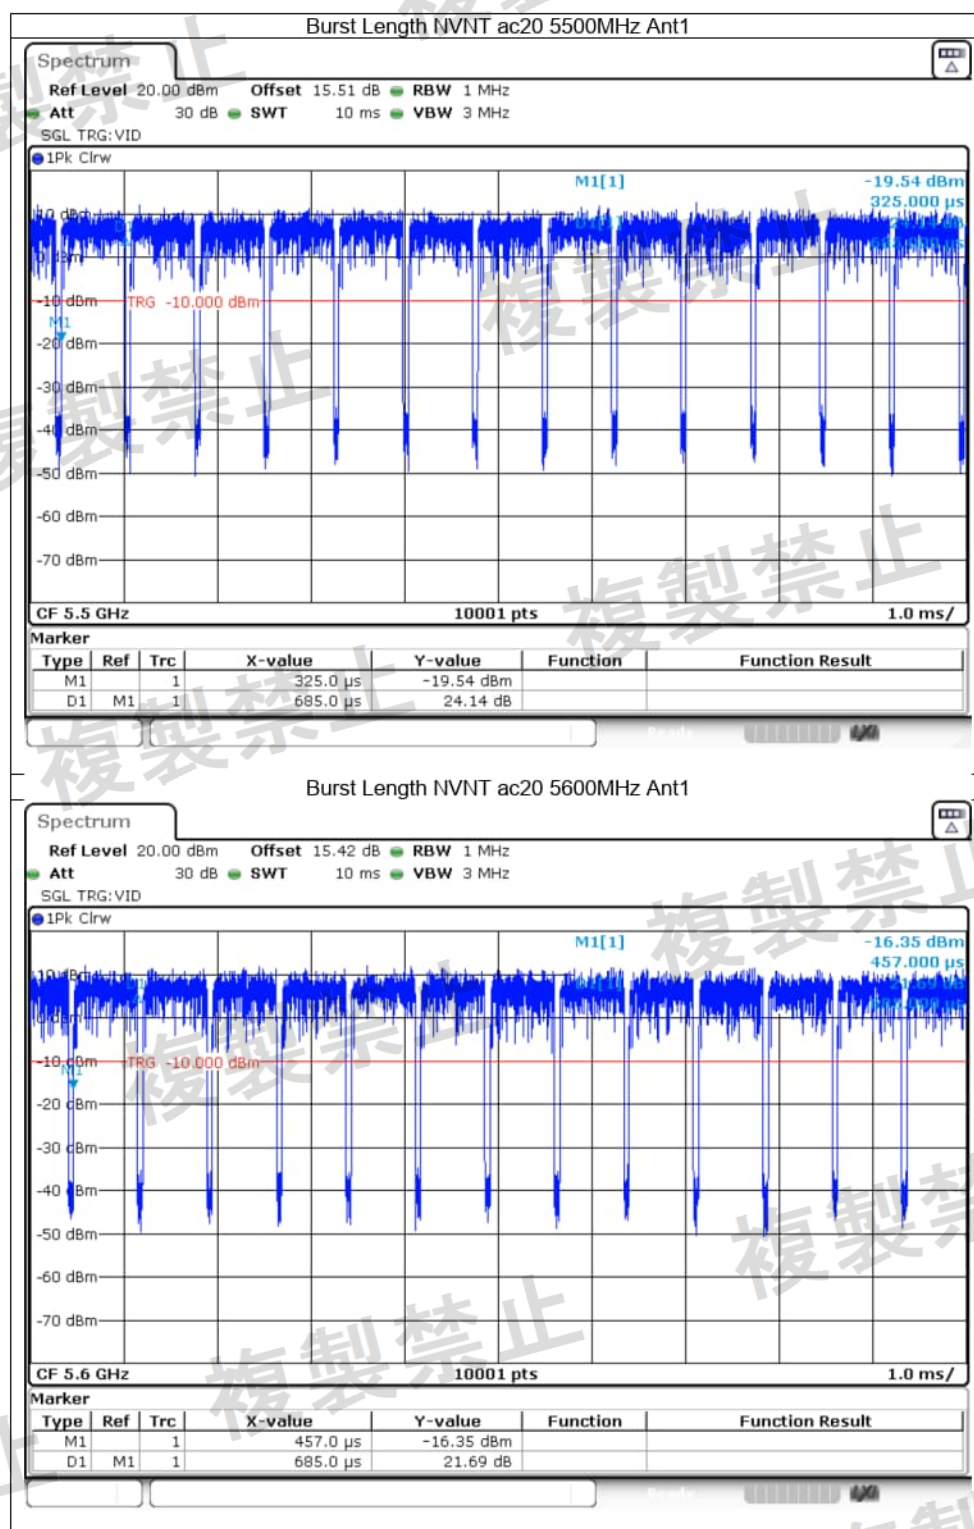


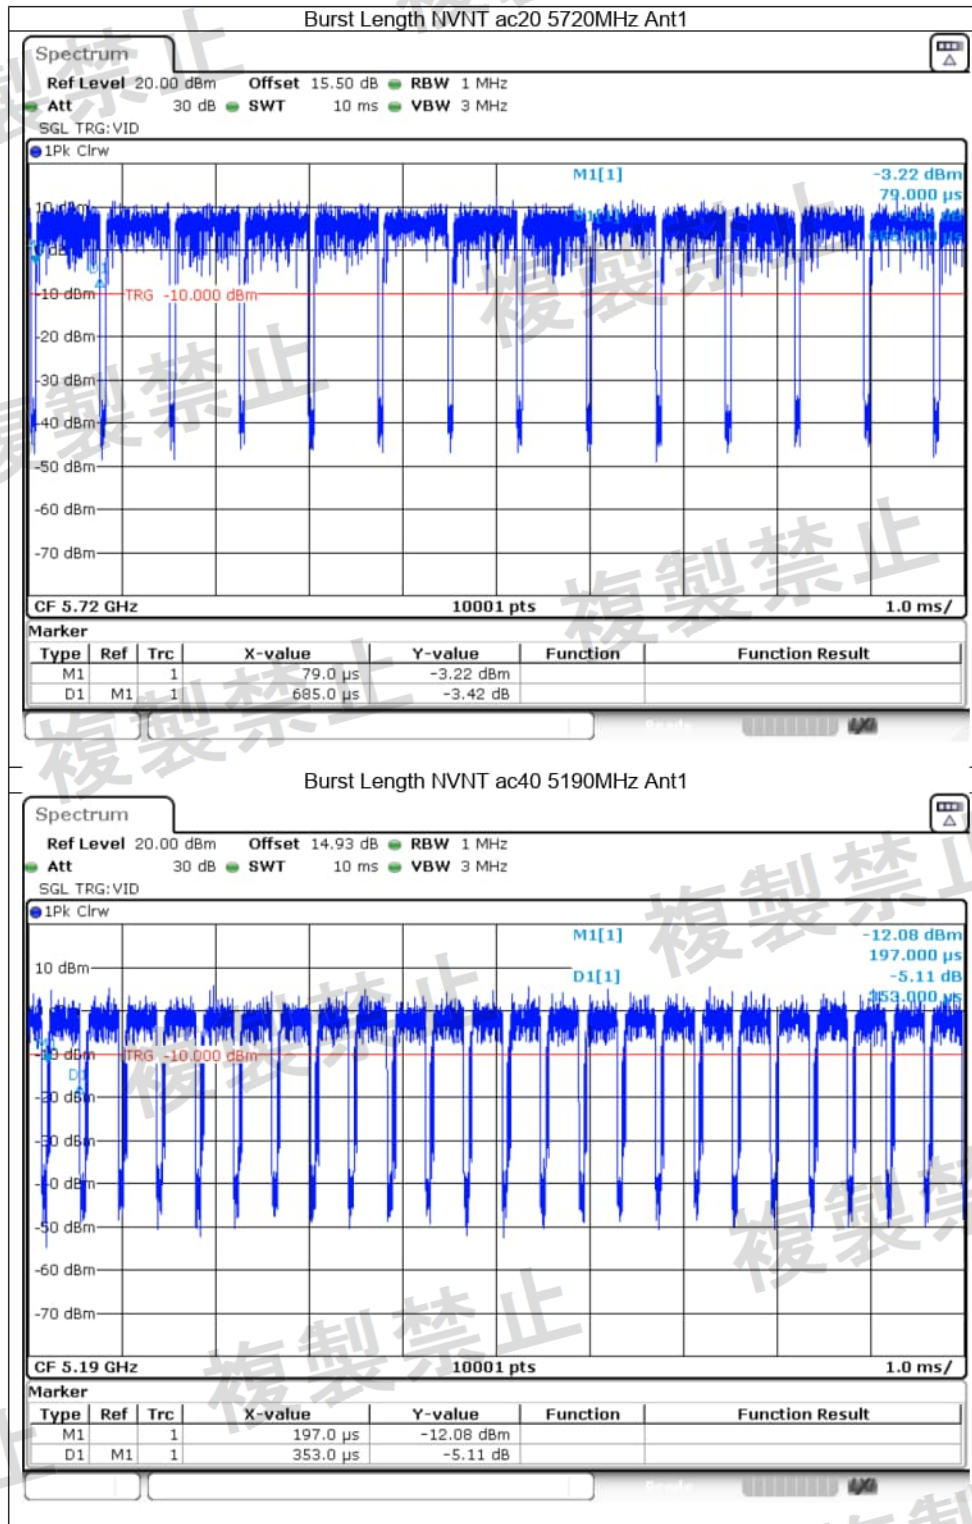


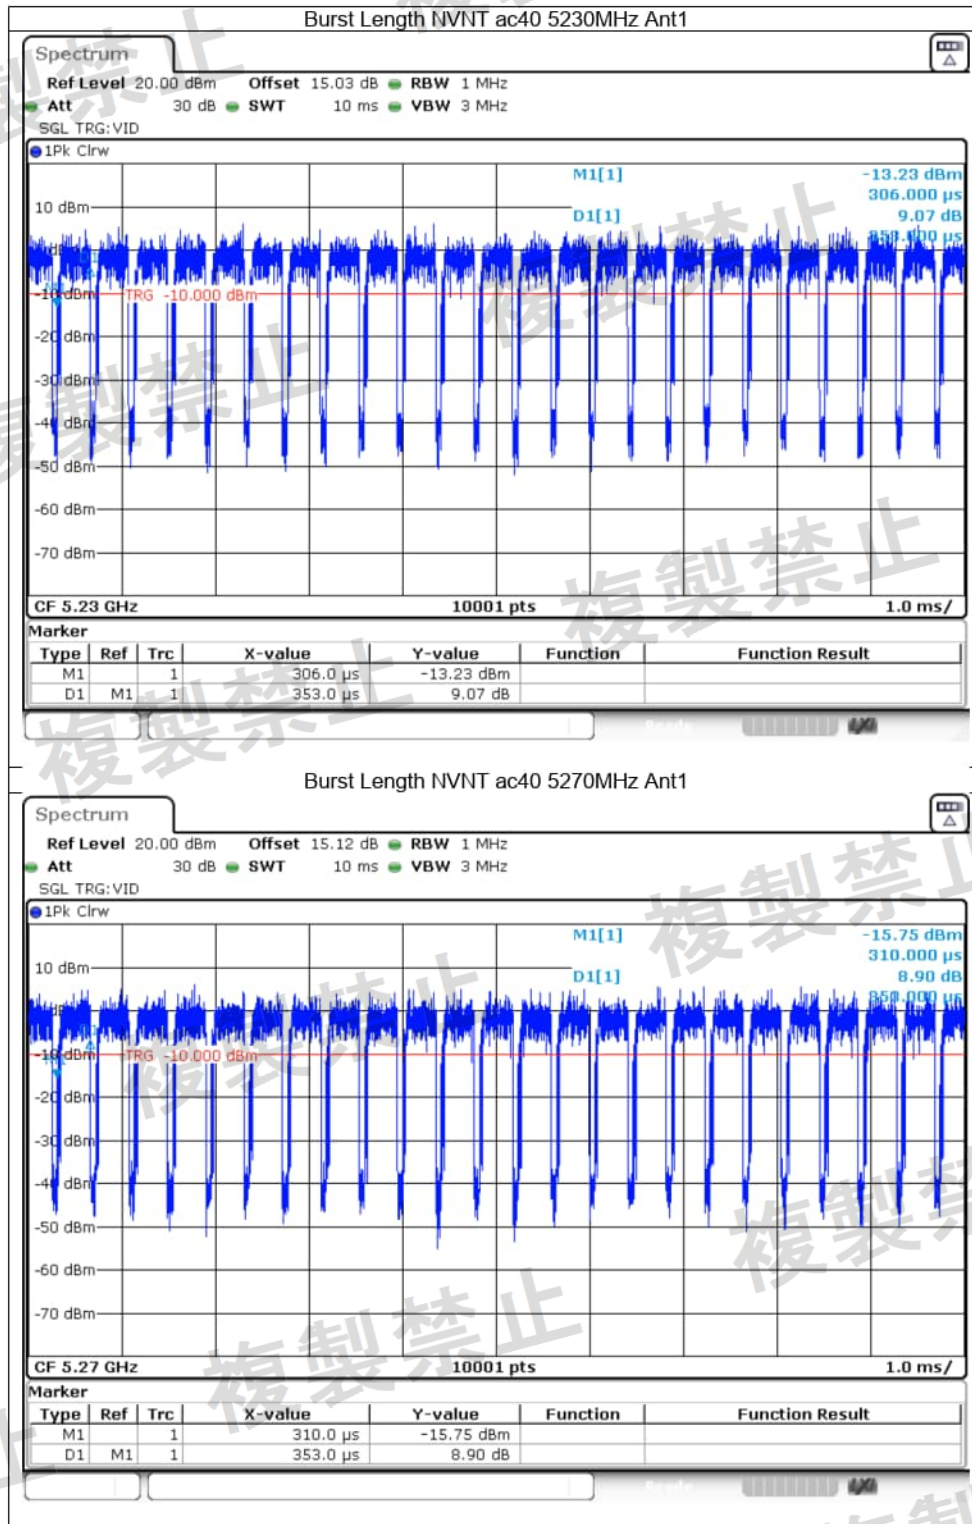


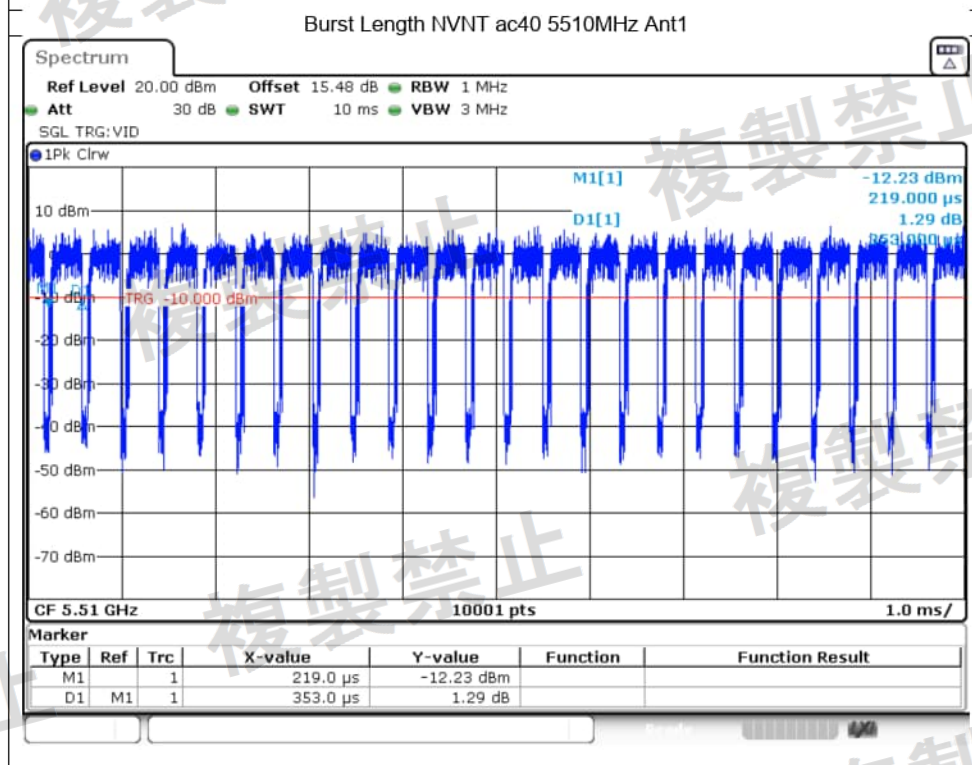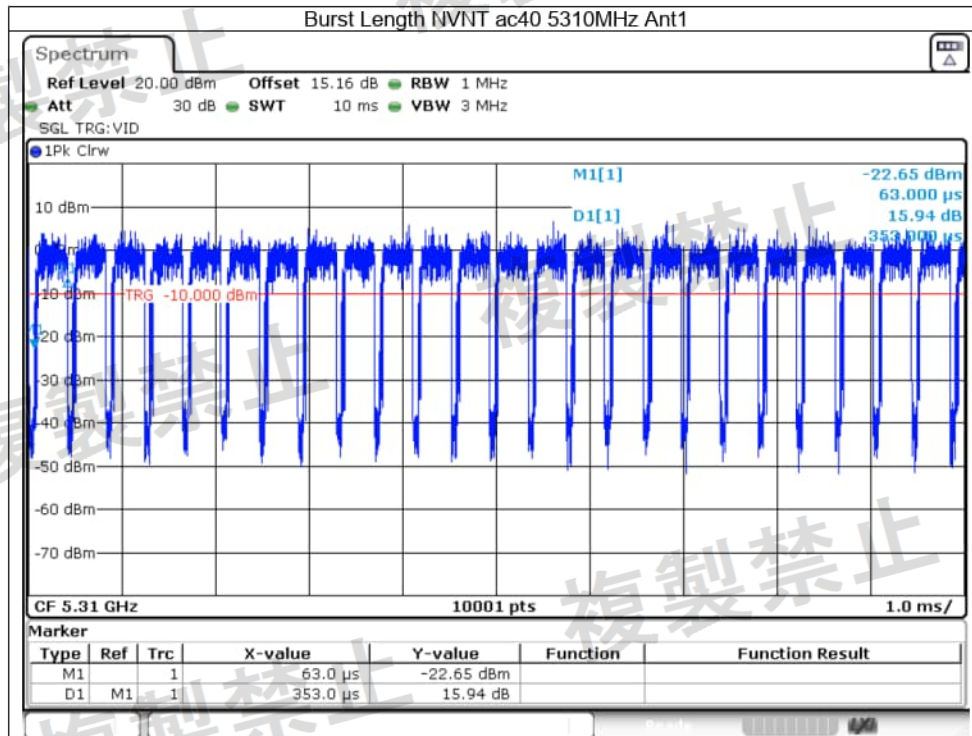

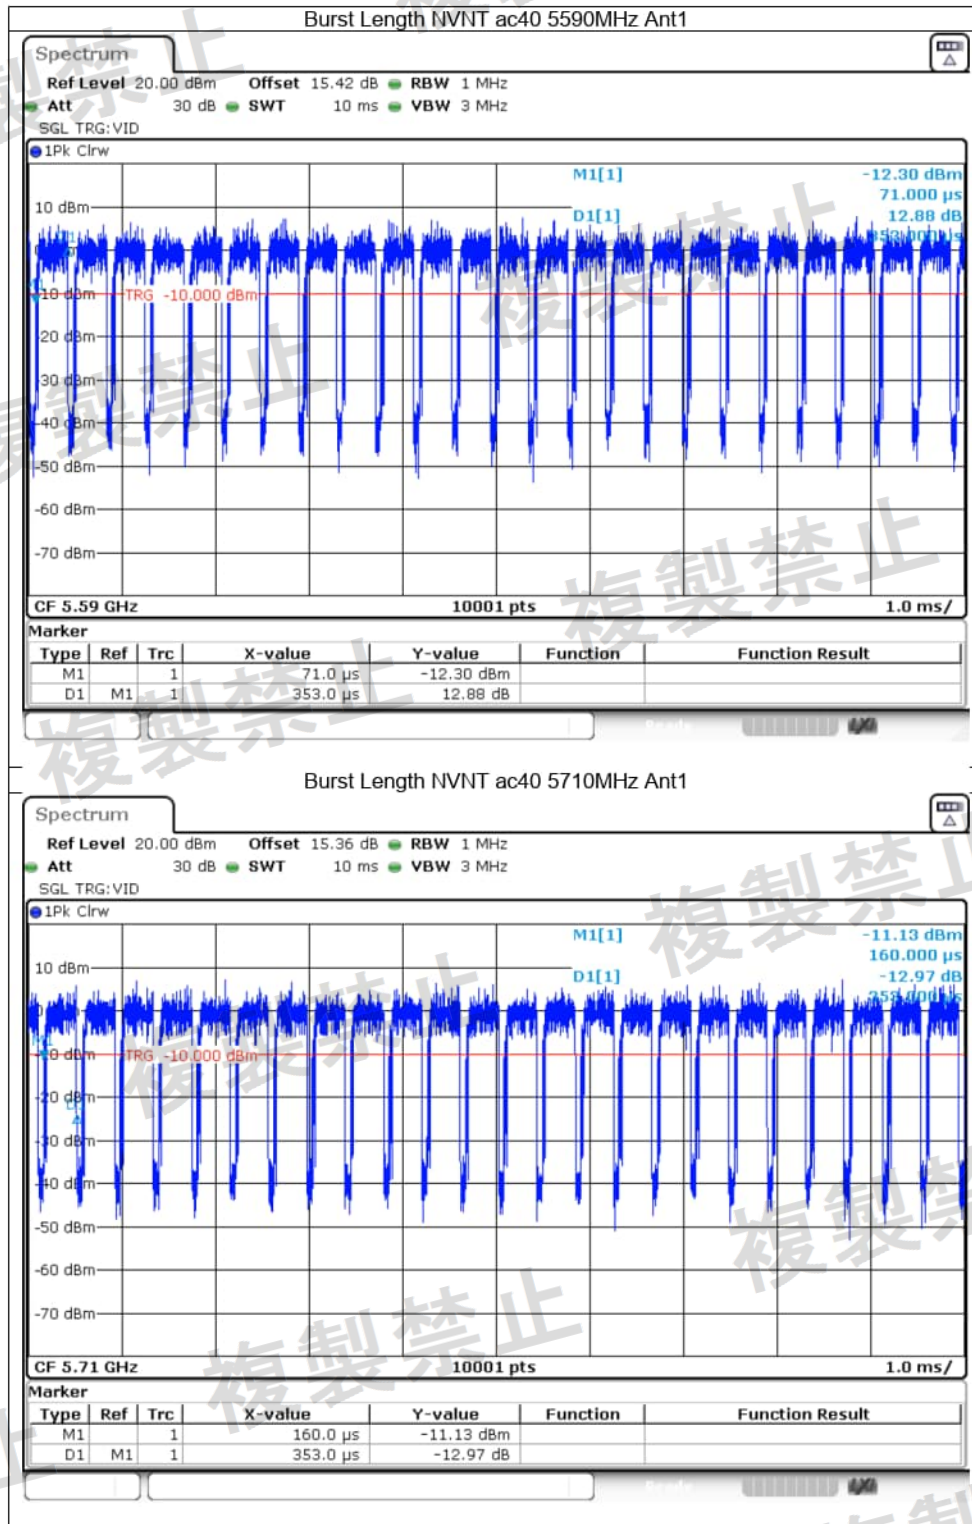

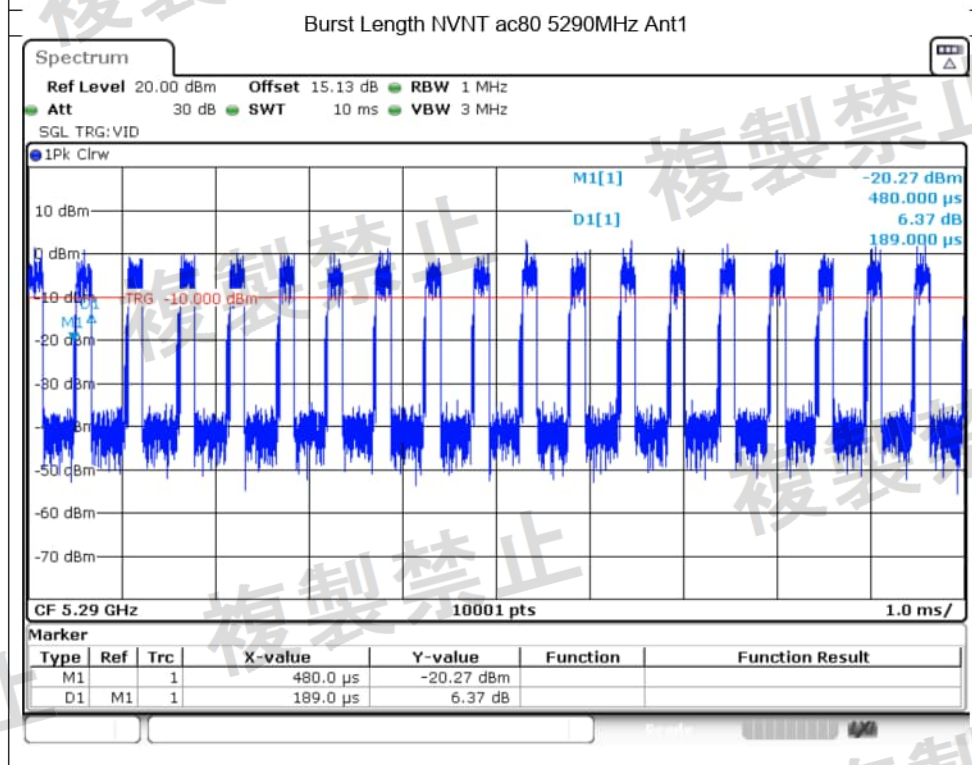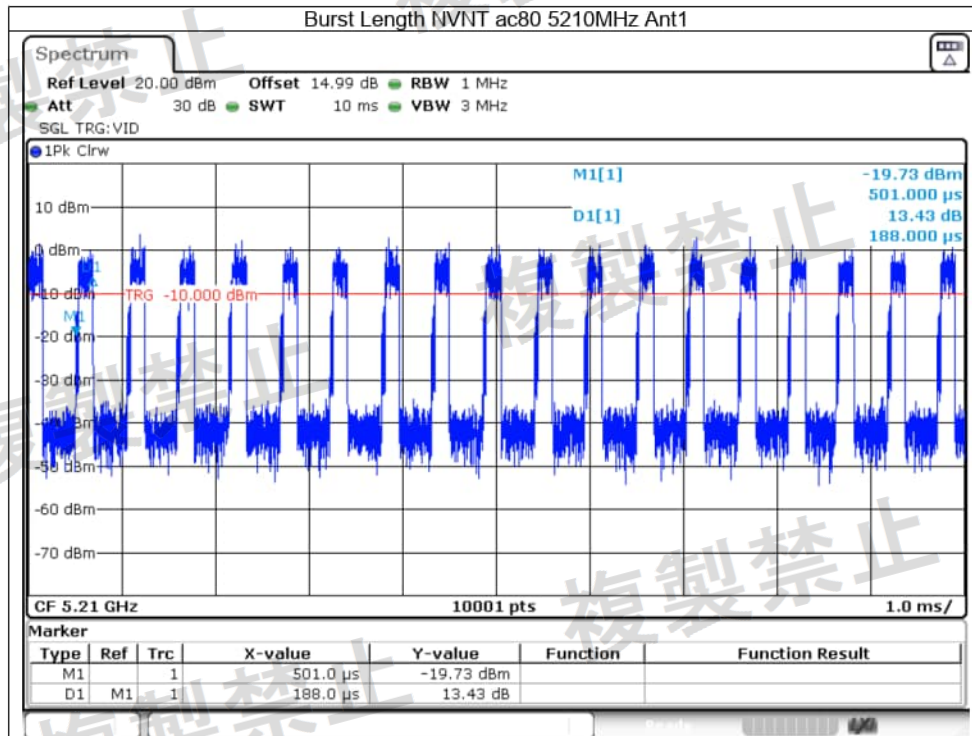


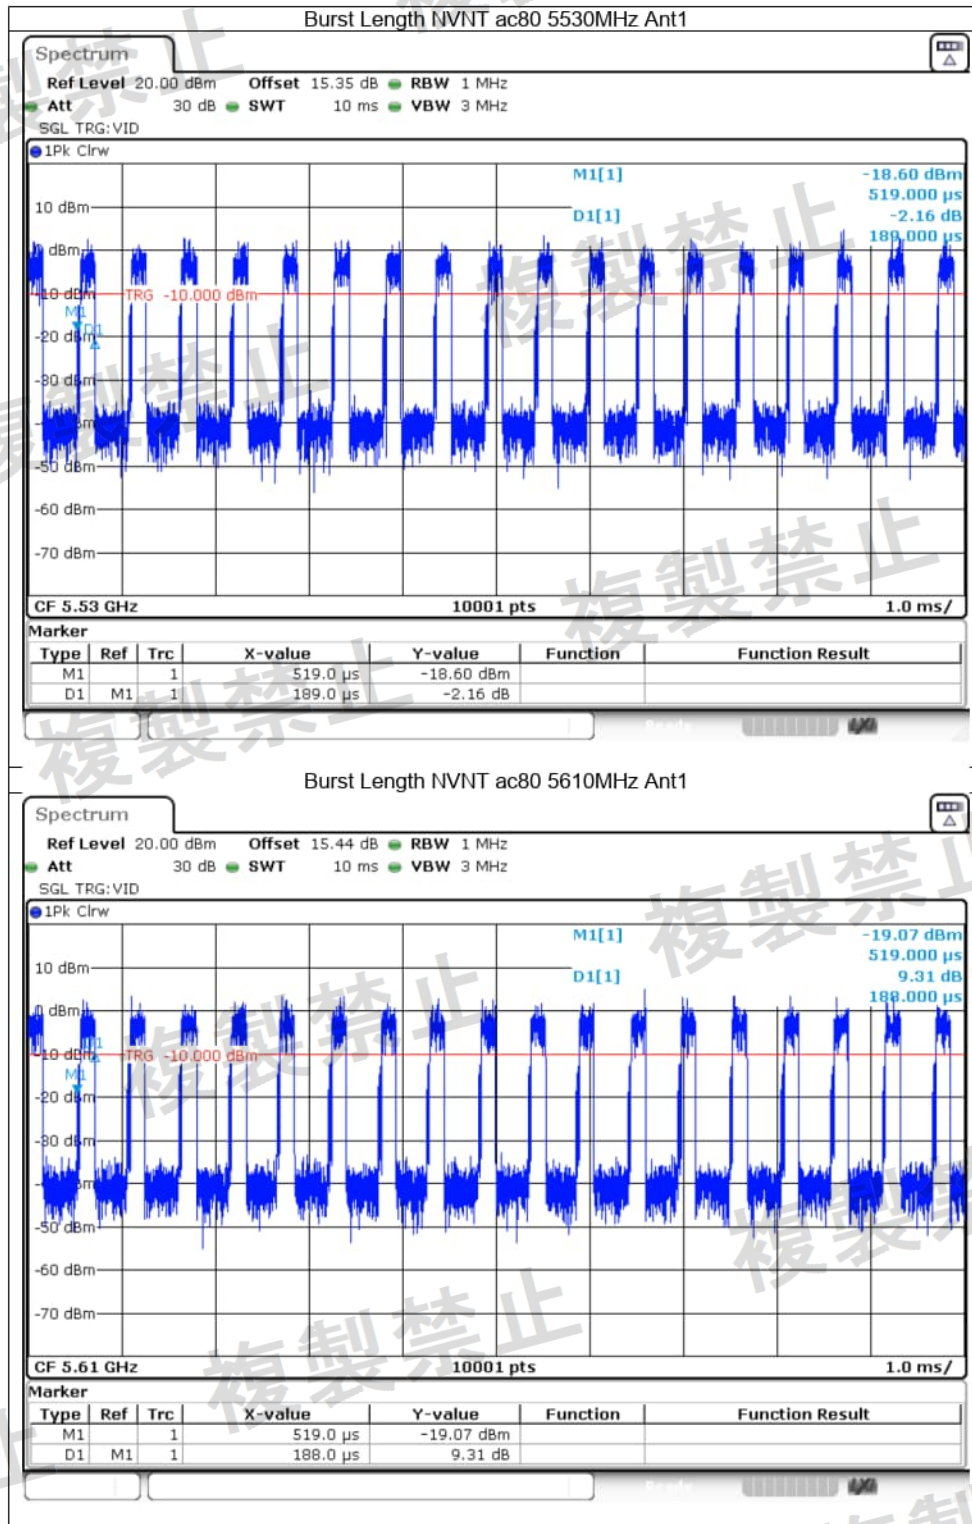

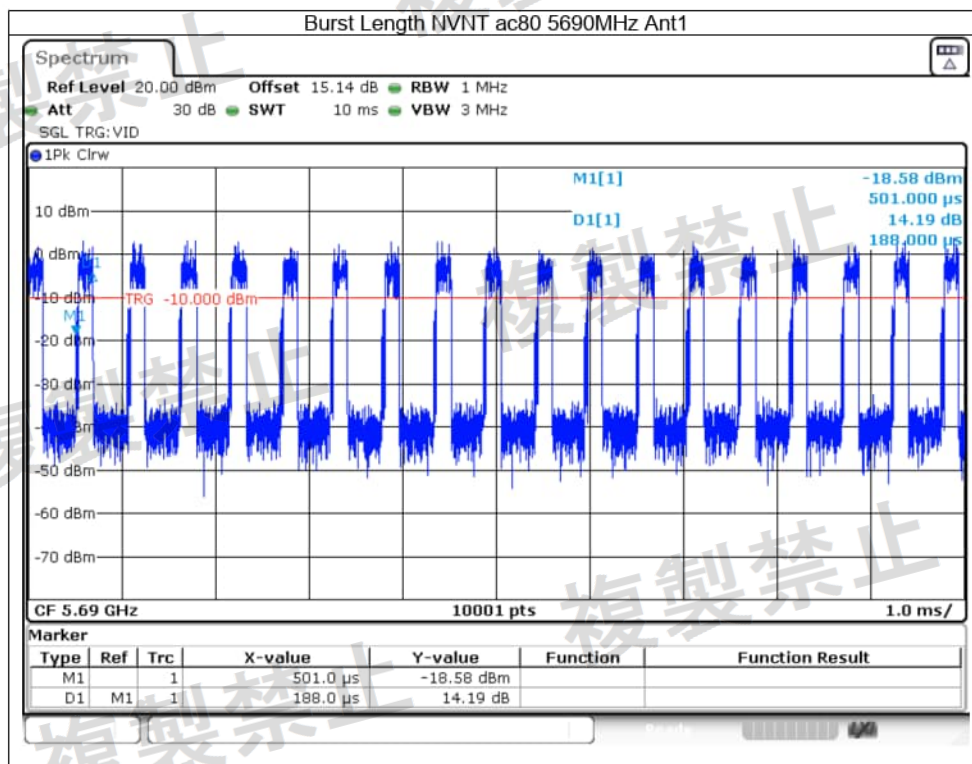


Test Graphs


Burst Length NVNT ac20 5180MHz Ant2

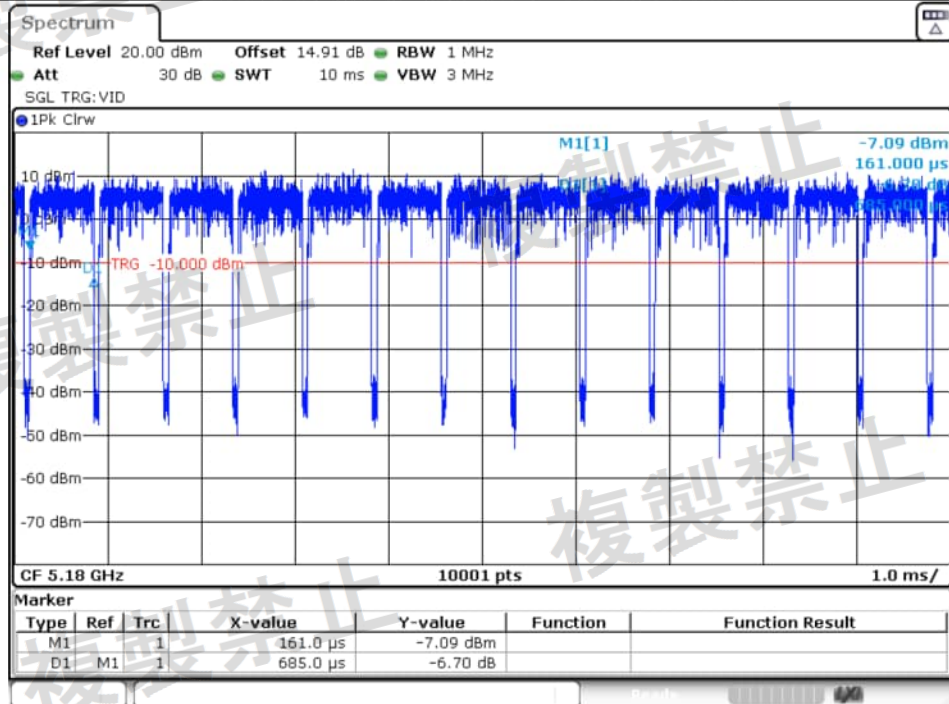


Burst Length NVNT ac20 5200MHz Ant2

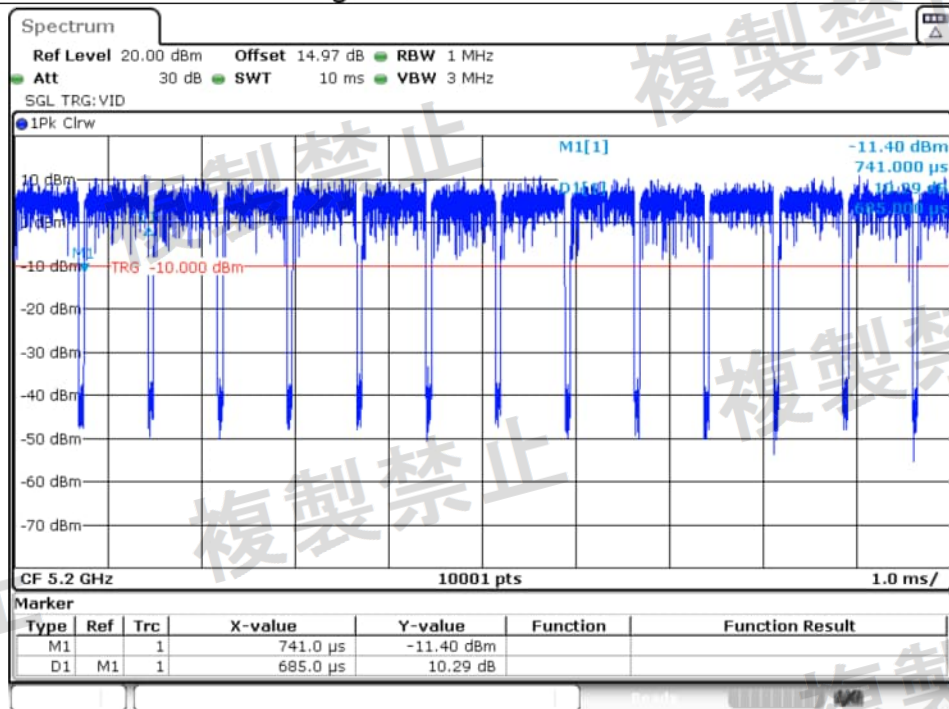


Burst Length NVNT ac20 5240MHz Ant2

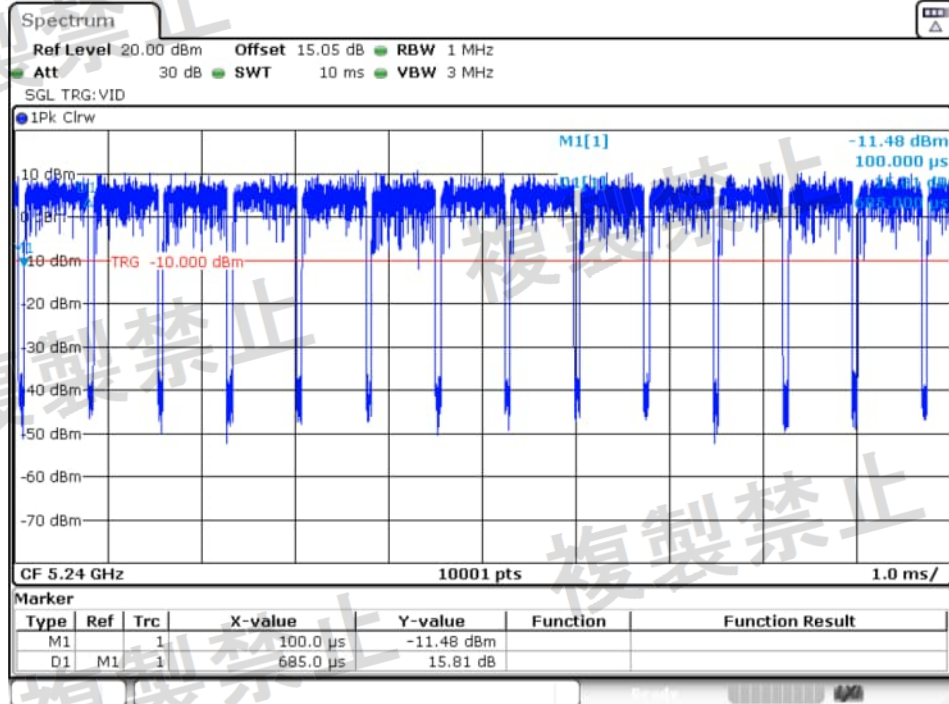


Burst Length NVNT ac20 5260MHz Ant2

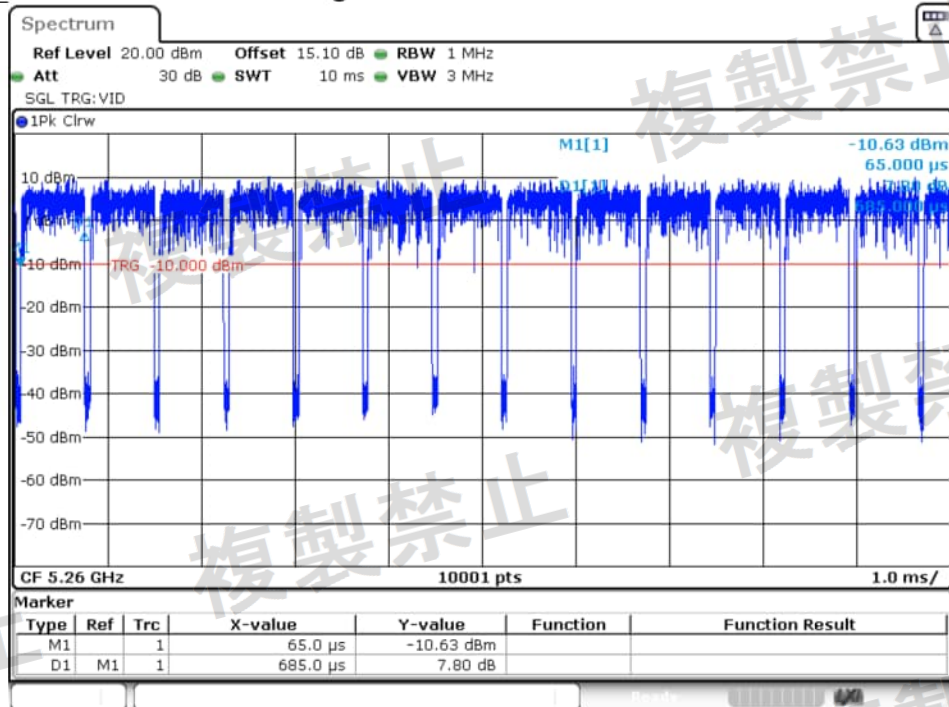

Burst Length NVNT ac20 5280MHz Ant2

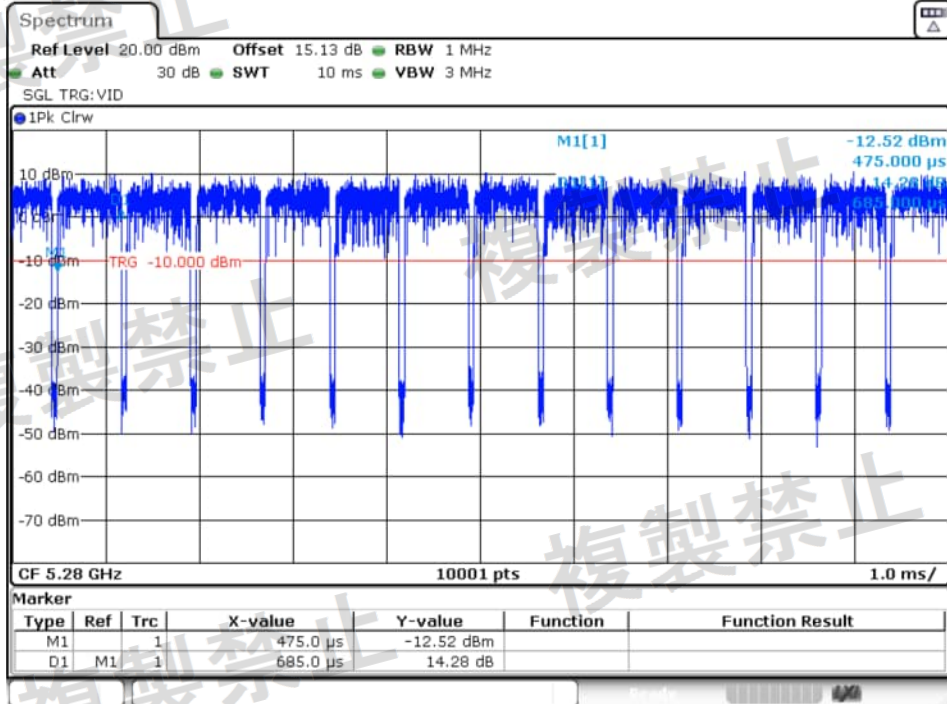


Burst Length NVNT ac20 5320MHz Ant2

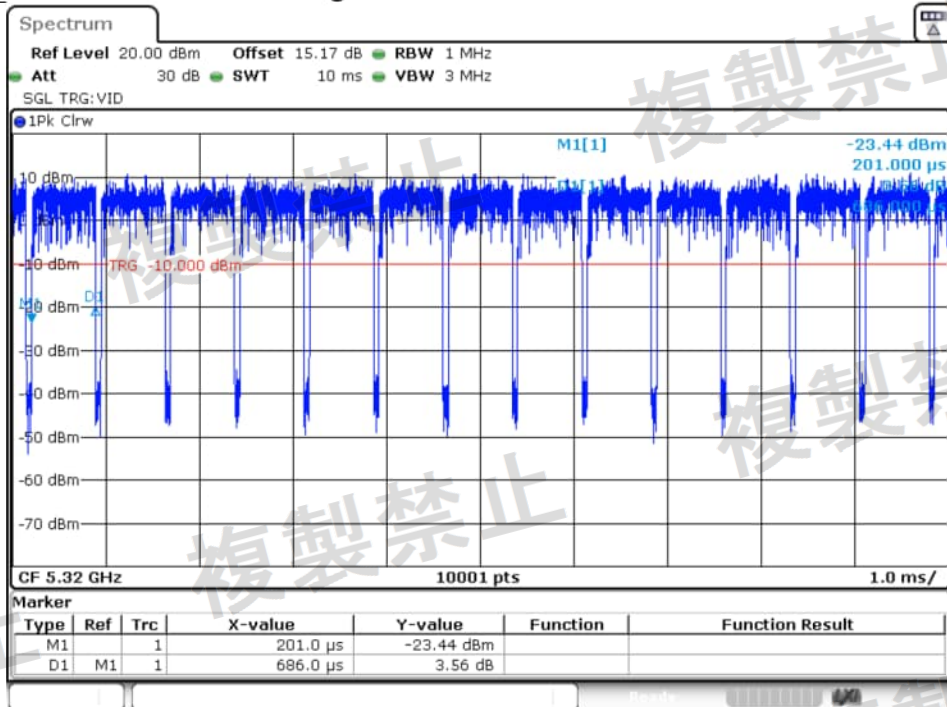




Burst Length NVNT ac20 5500MHz Ant2

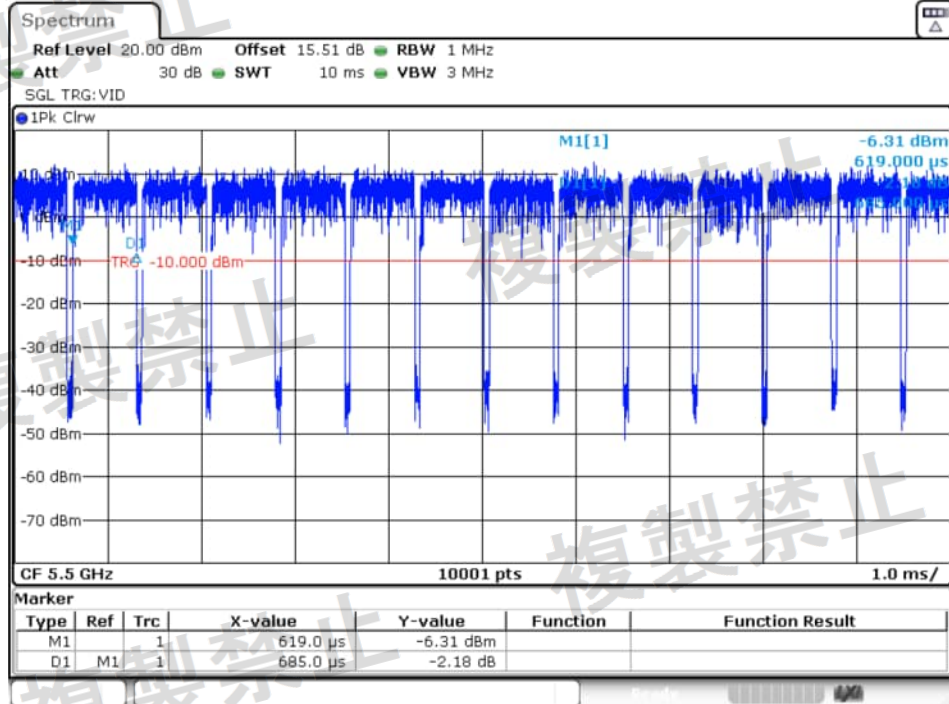


Burst Length NVNT ac20 5600MHz Ant2

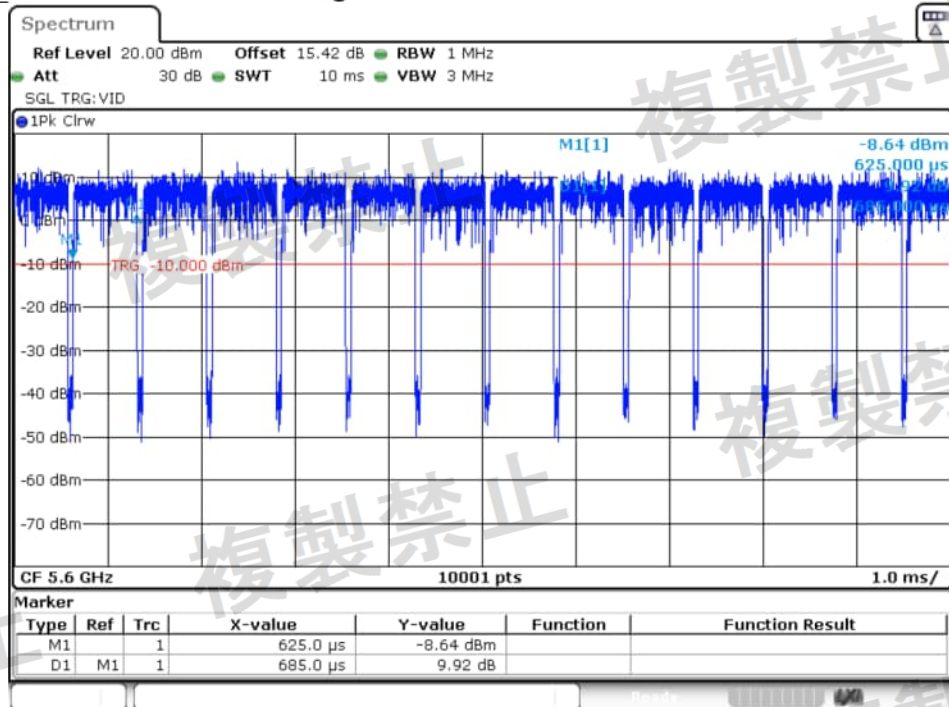




Burst Length NVNT ac20 5720MHz Ant2

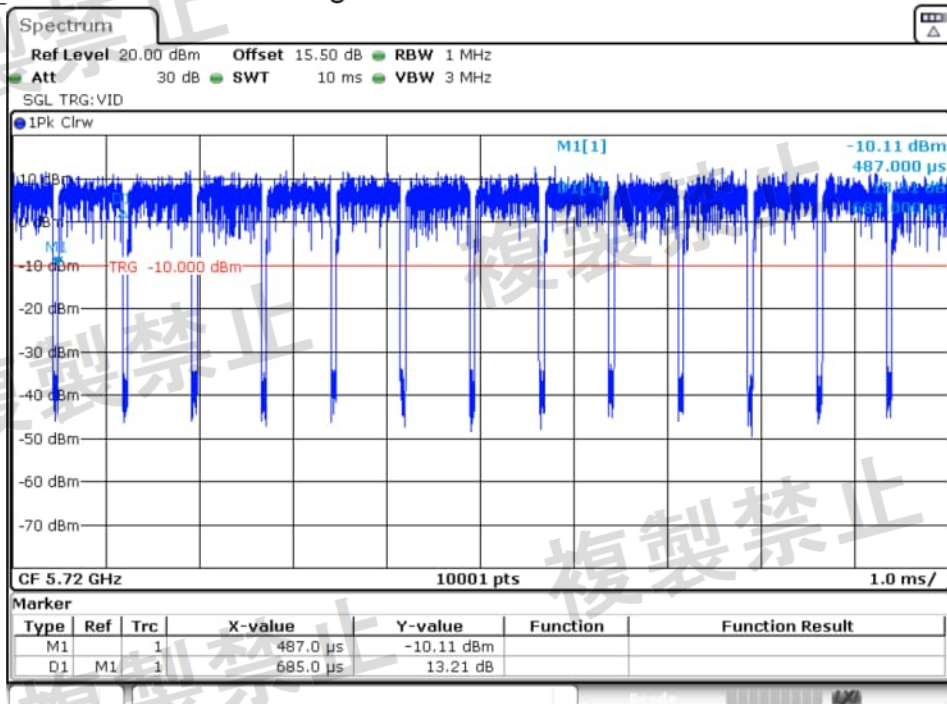


Burst Length NVNT ac40 5190MHz Ant2

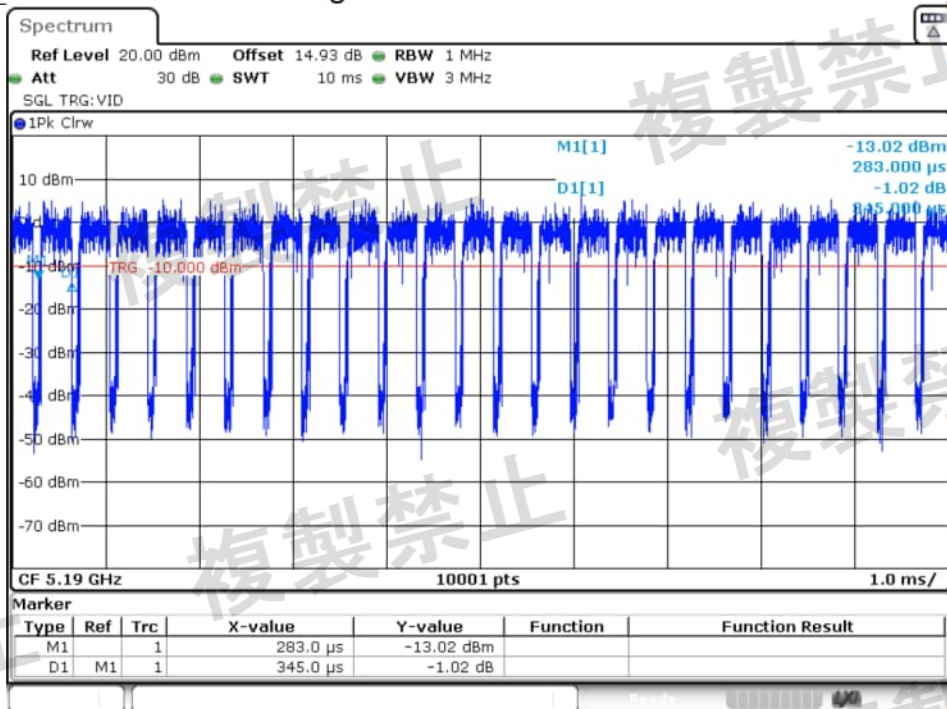





Burst Length NVNT ac40 5230MHz Ant2

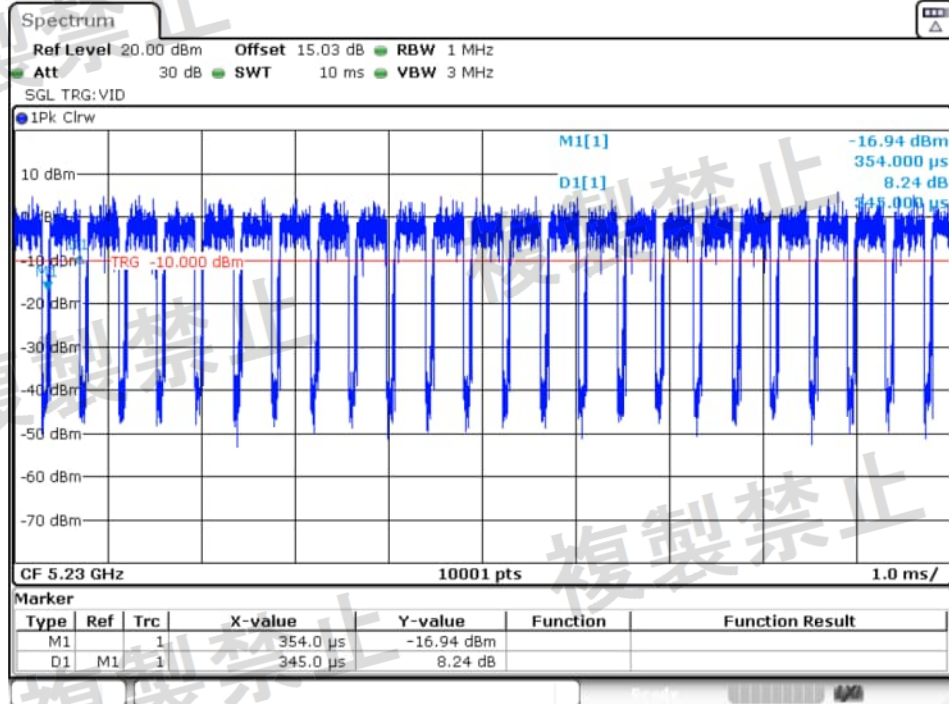


Burst Length NVNT ac40 5270MHz Ant2

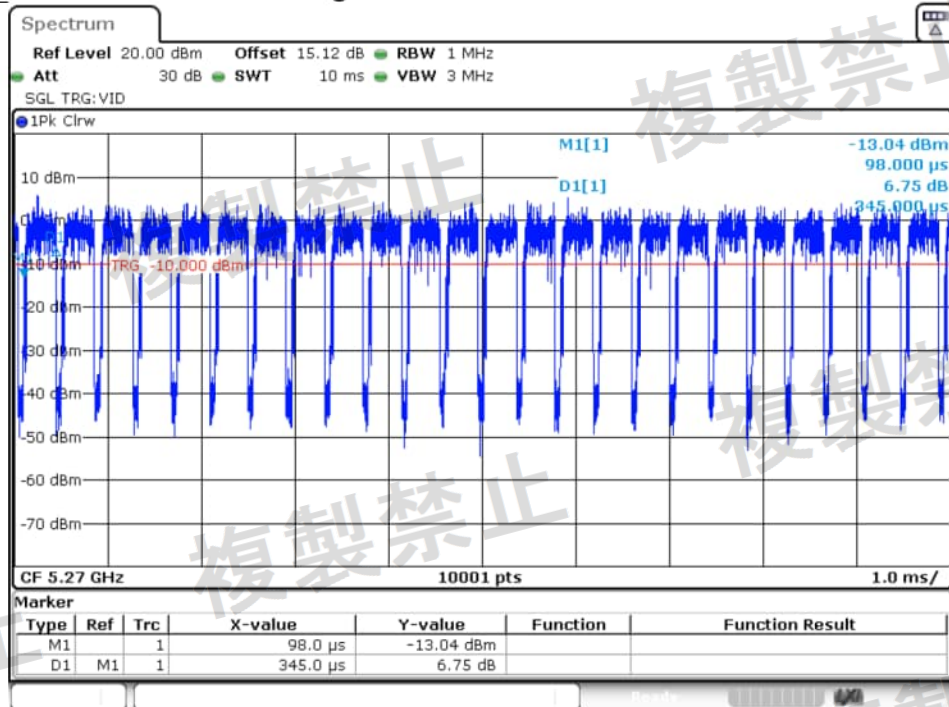


Burst Length NVNT ac40 5310MHz Ant2

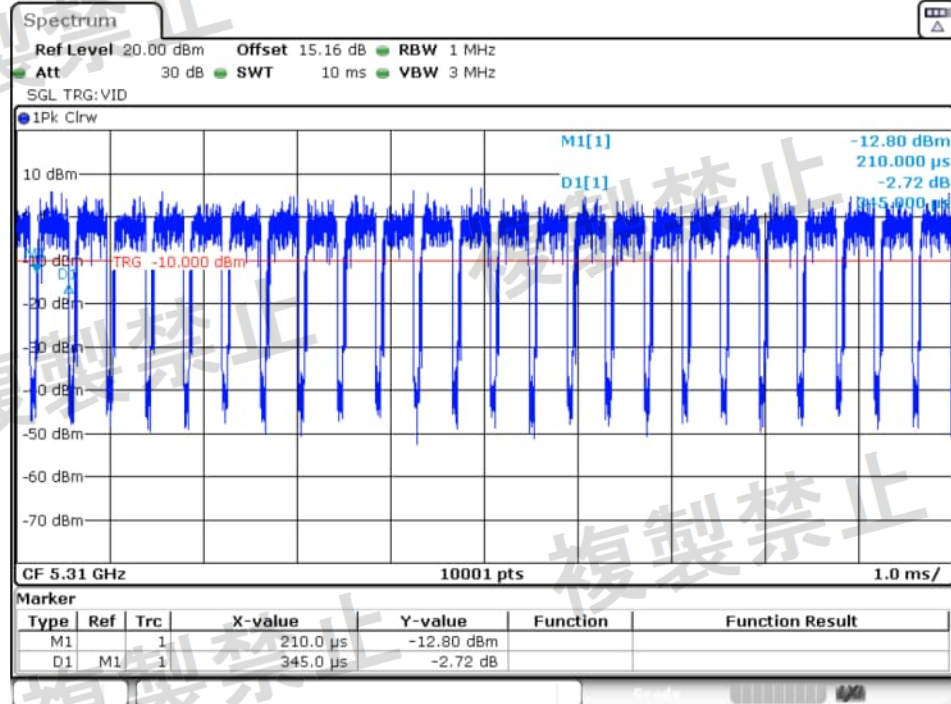


Burst Length NVNT ac40 5510MHz Ant2

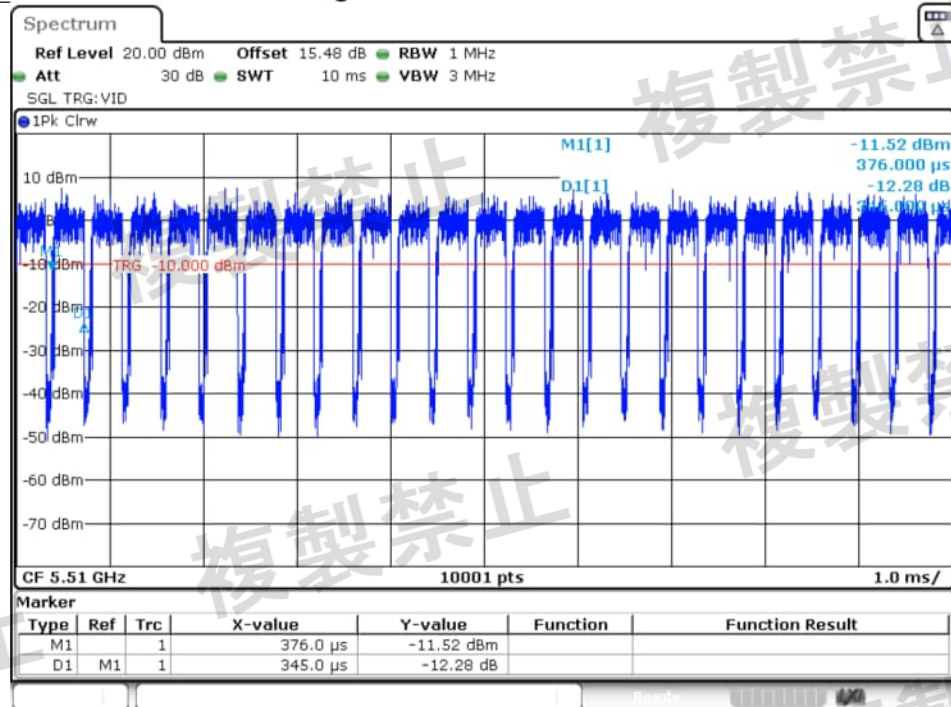


Burst Length NVNT ac40 5590MHz Ant2

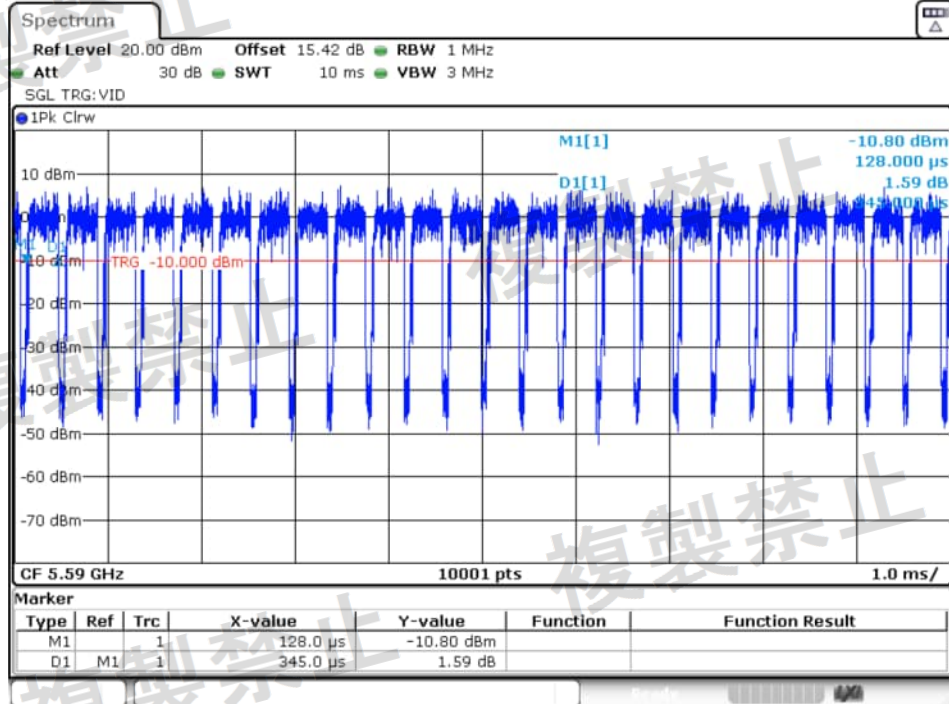


Burst Length NVNT ac40 5710MHz Ant2

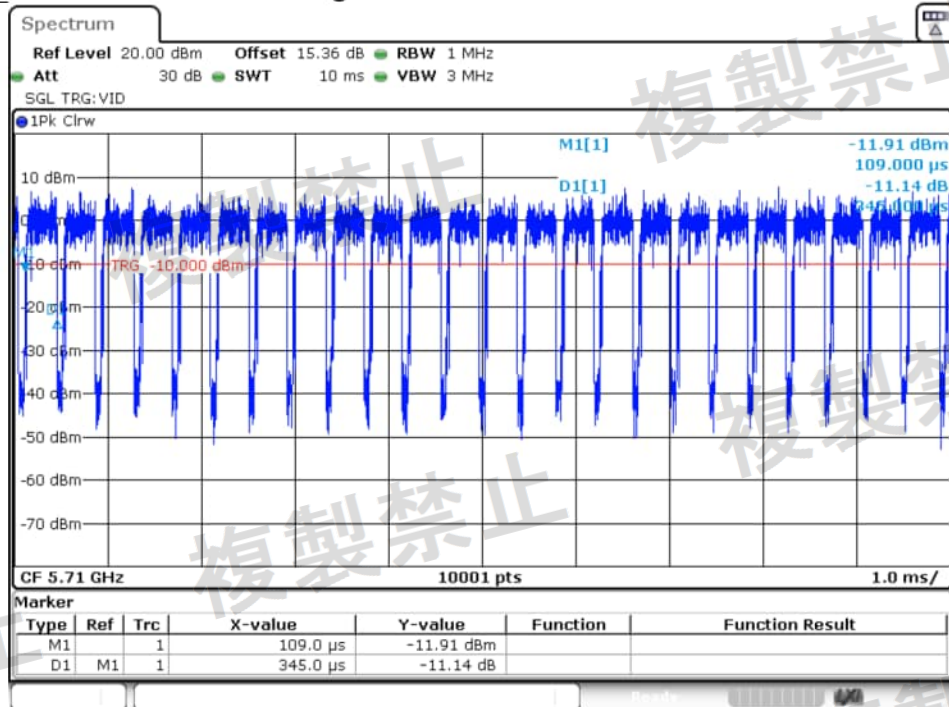


Burst Length NVNT ac80 5210MHz Ant2

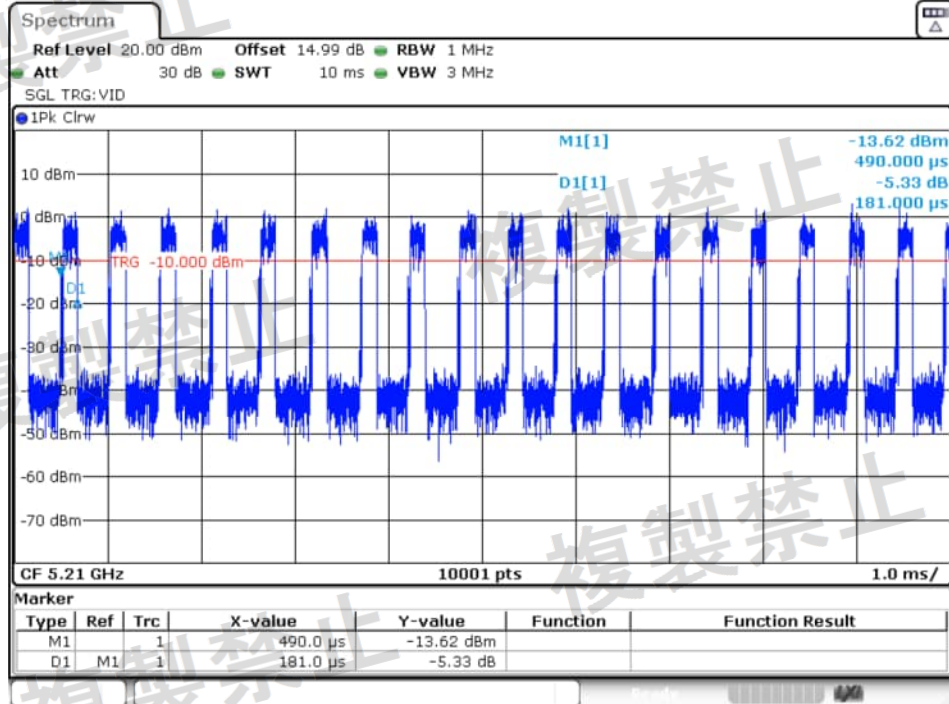


Burst Length NVNT ac80 5290MHz Ant2

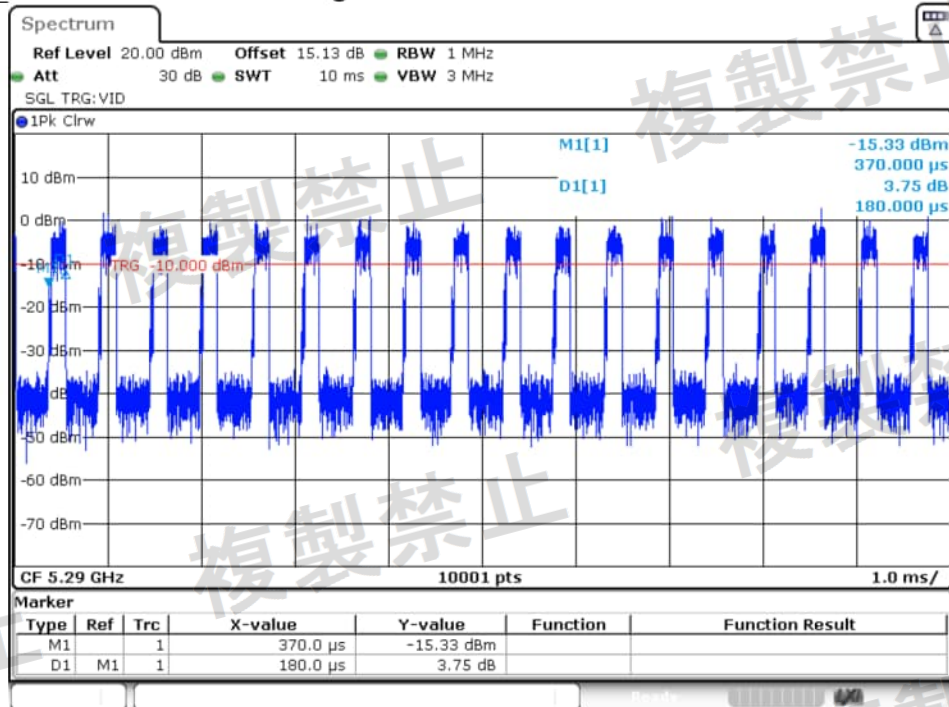




Burst Length NVNT ac80 5530MHz Ant2

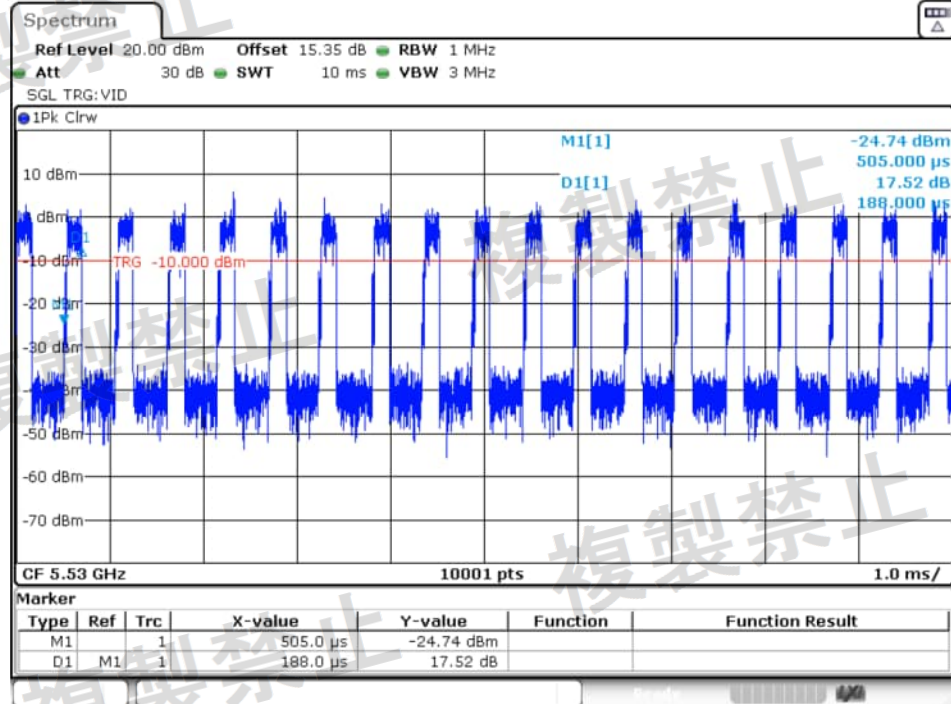




Burst Length NVNT ac80 5610MHz Ant2

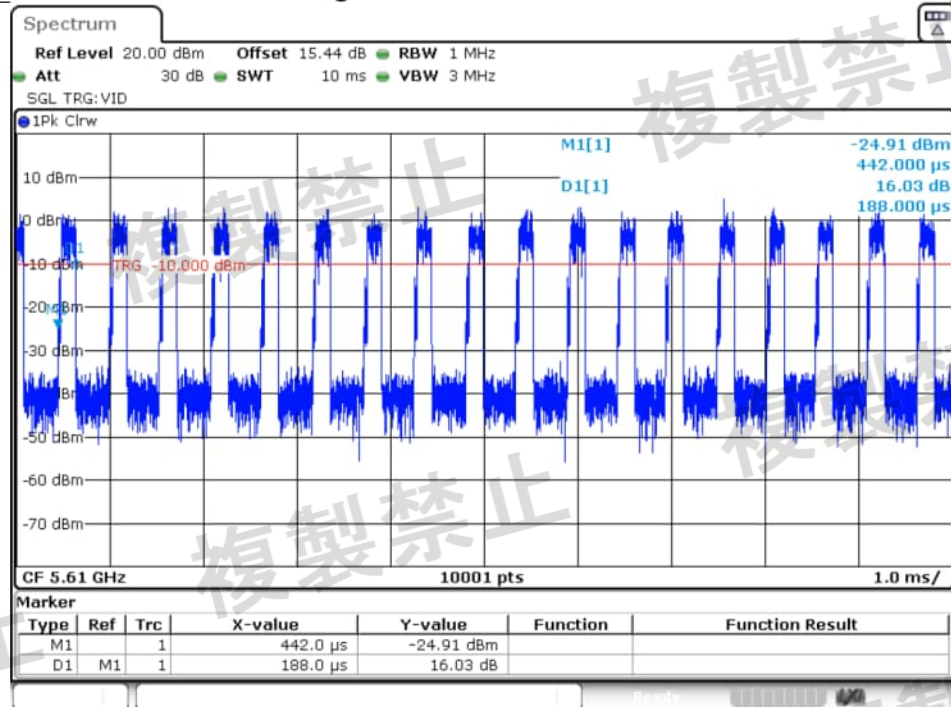


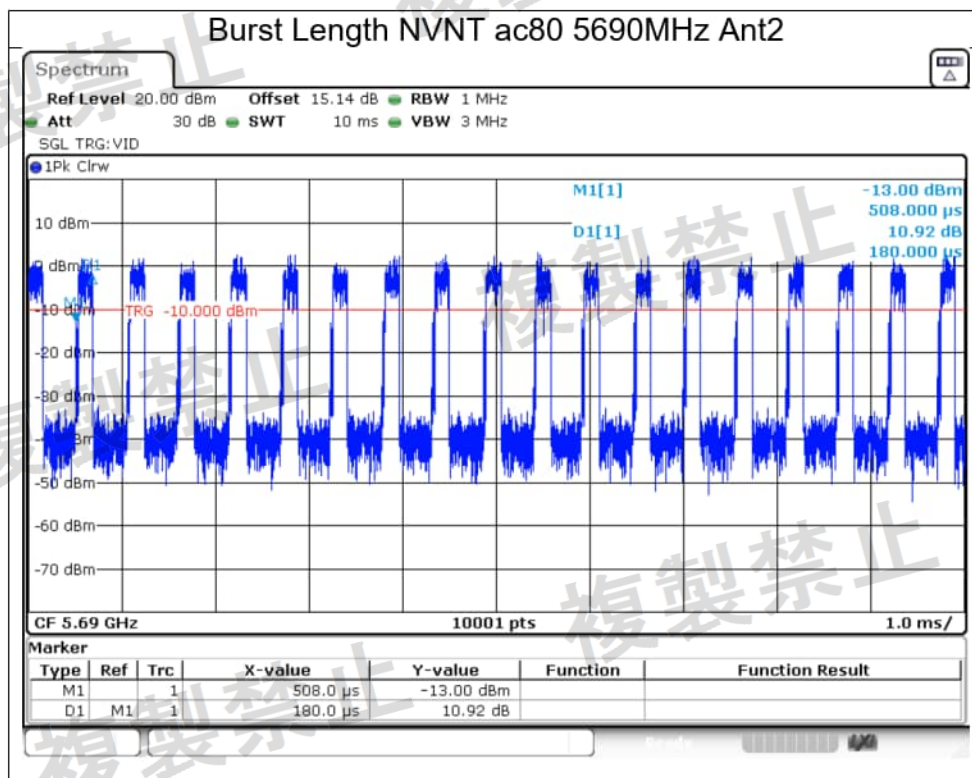


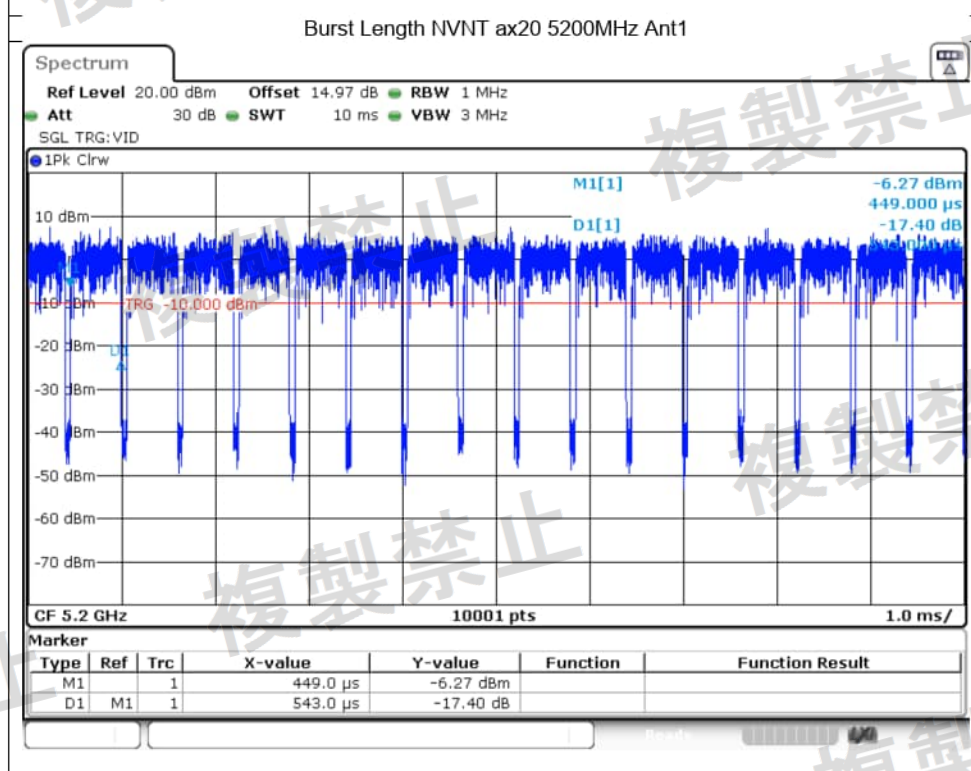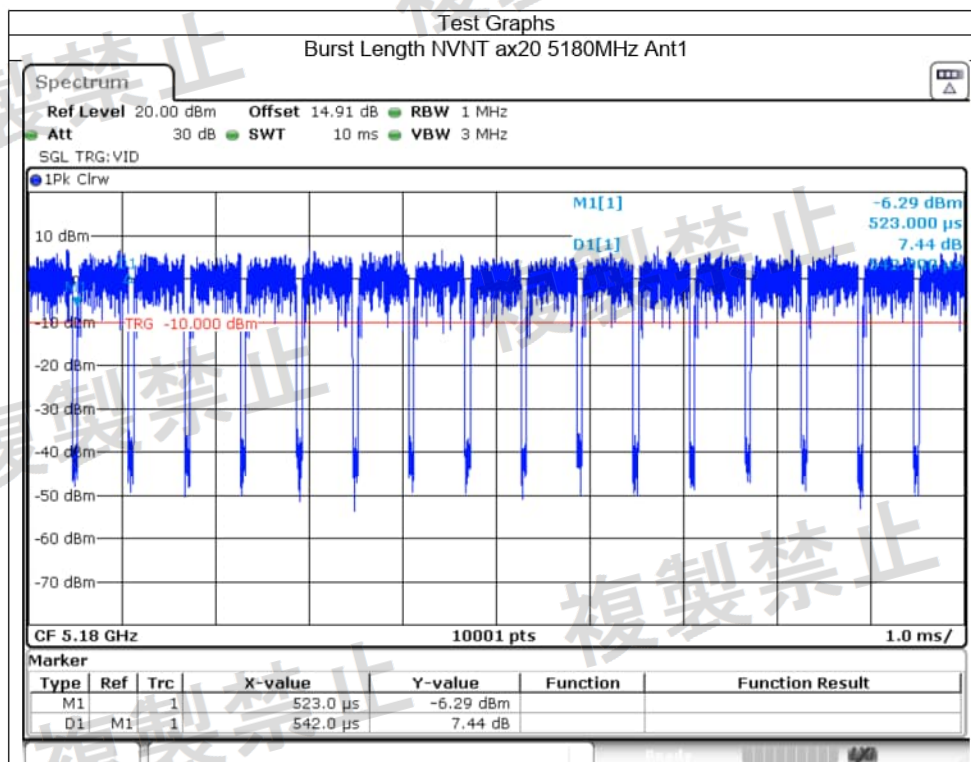


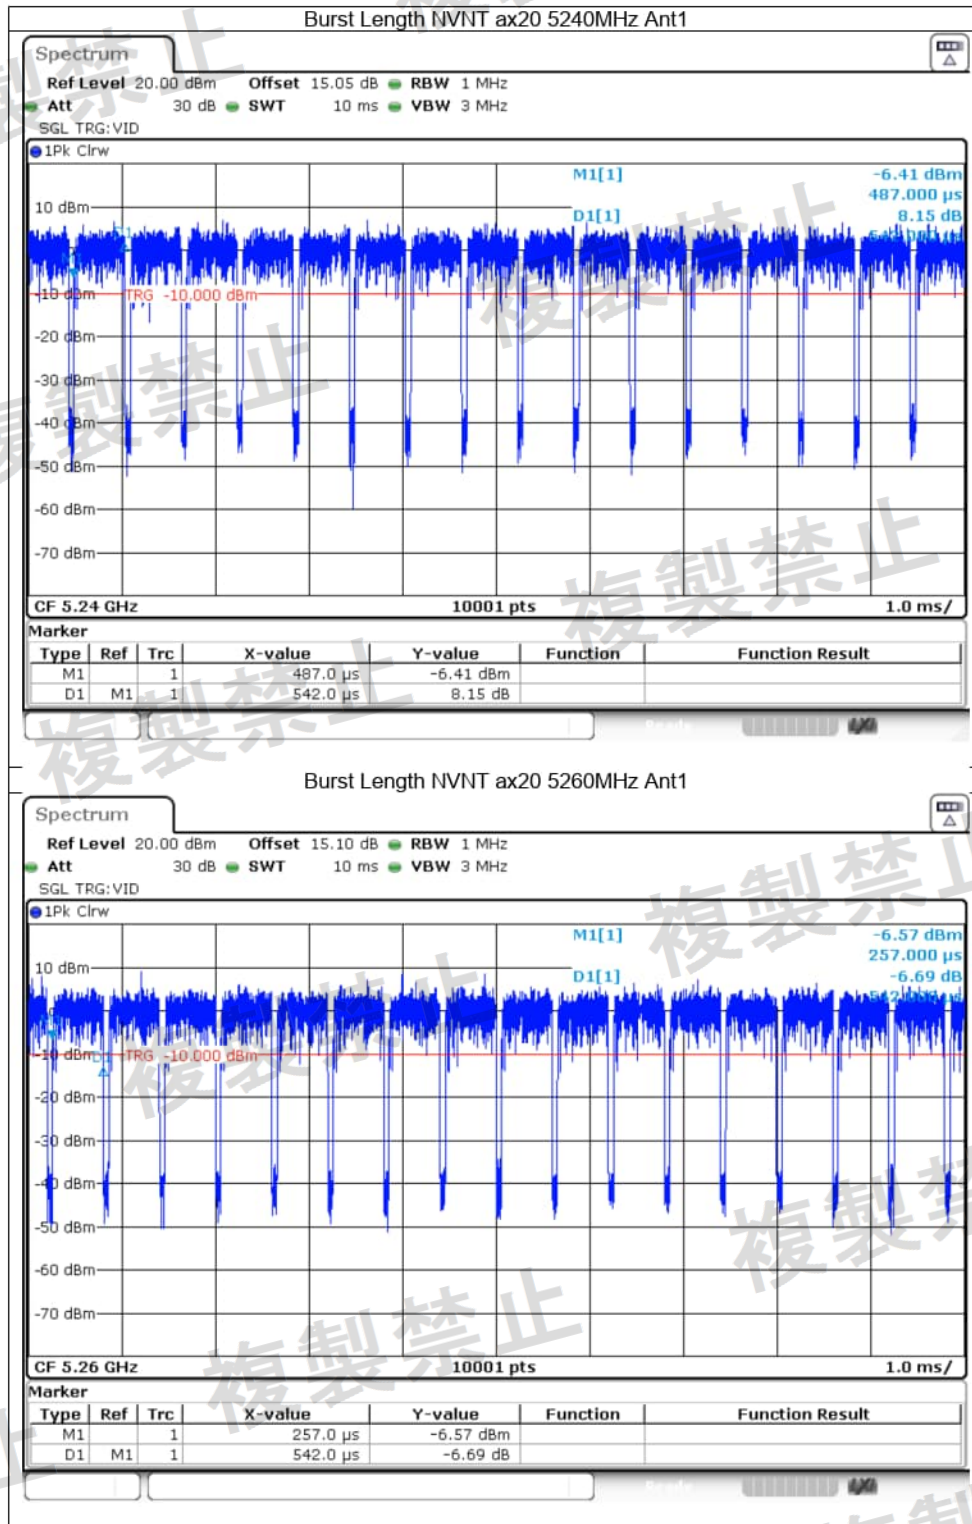


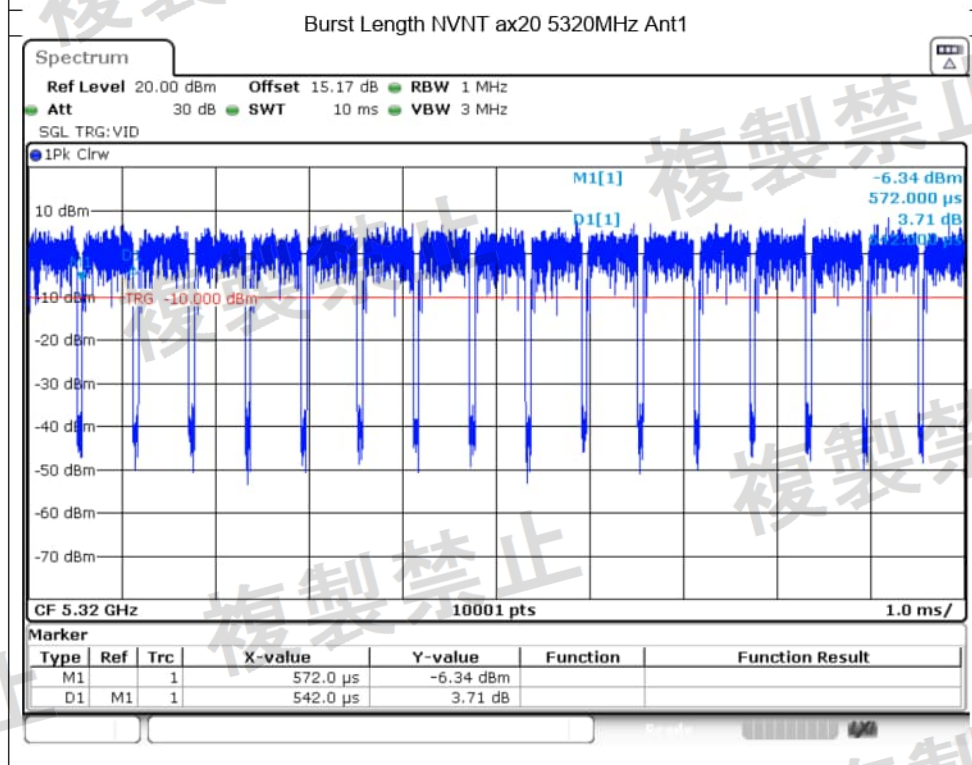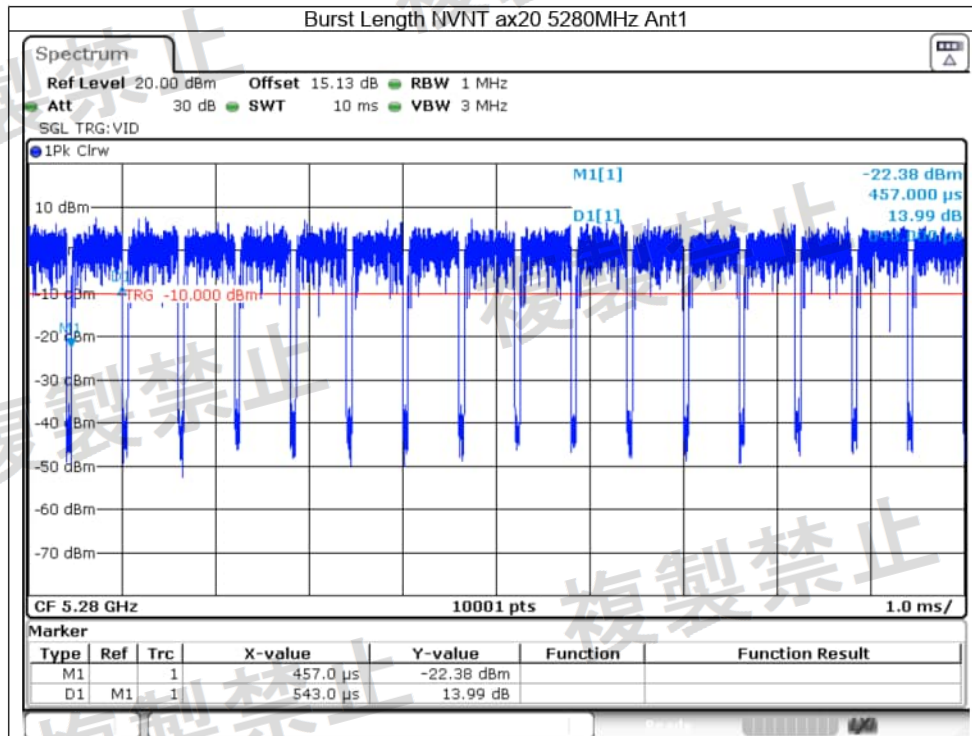


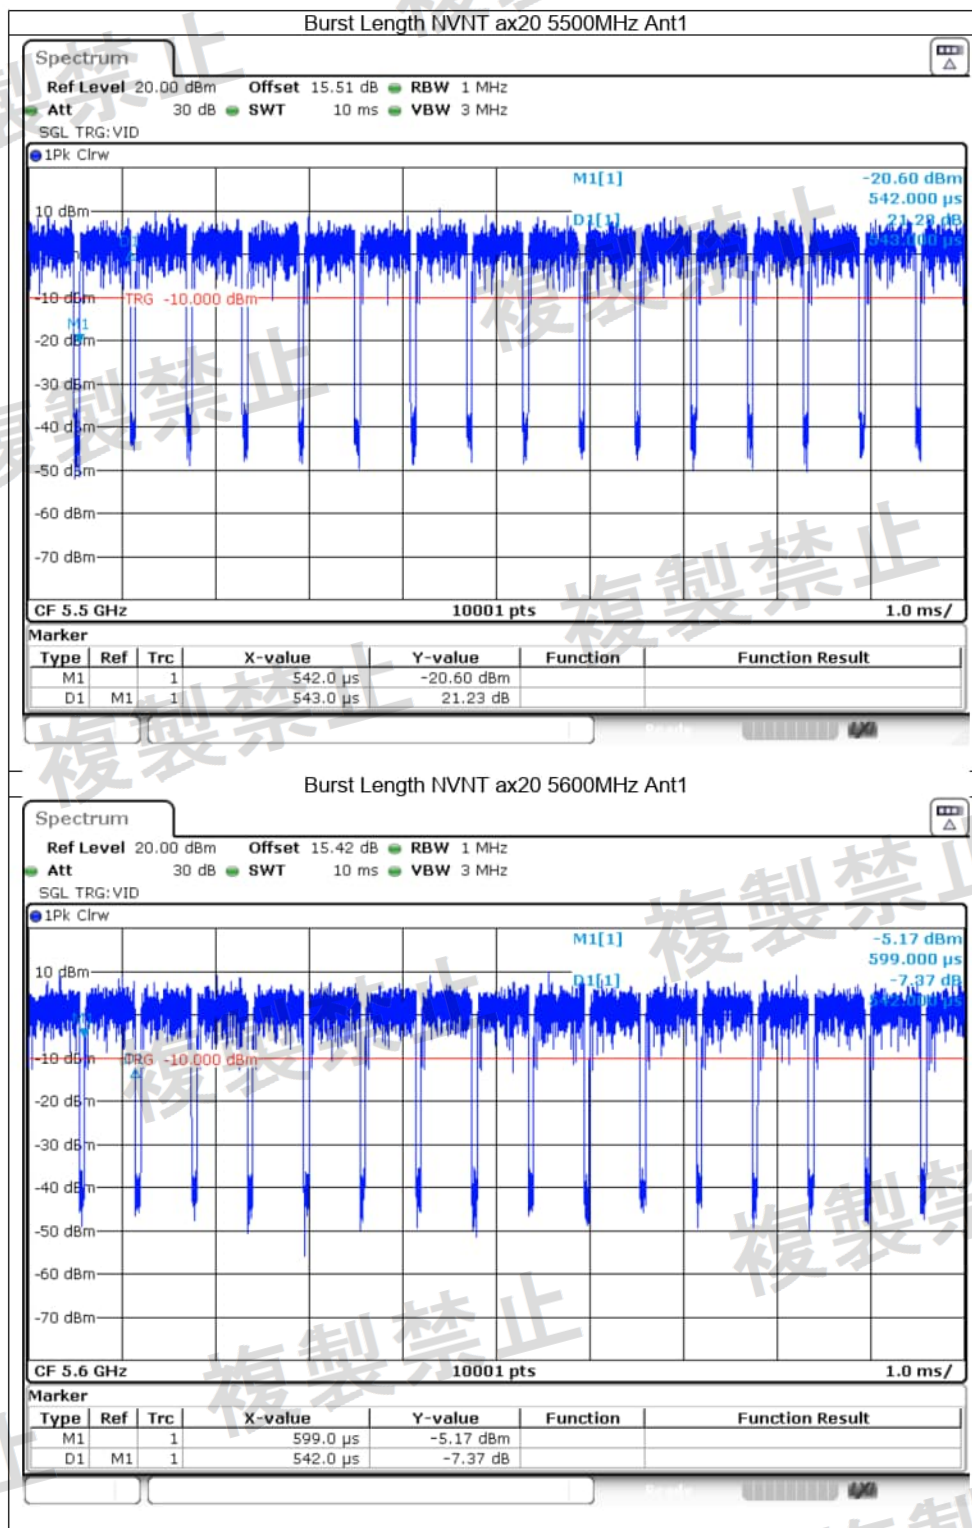


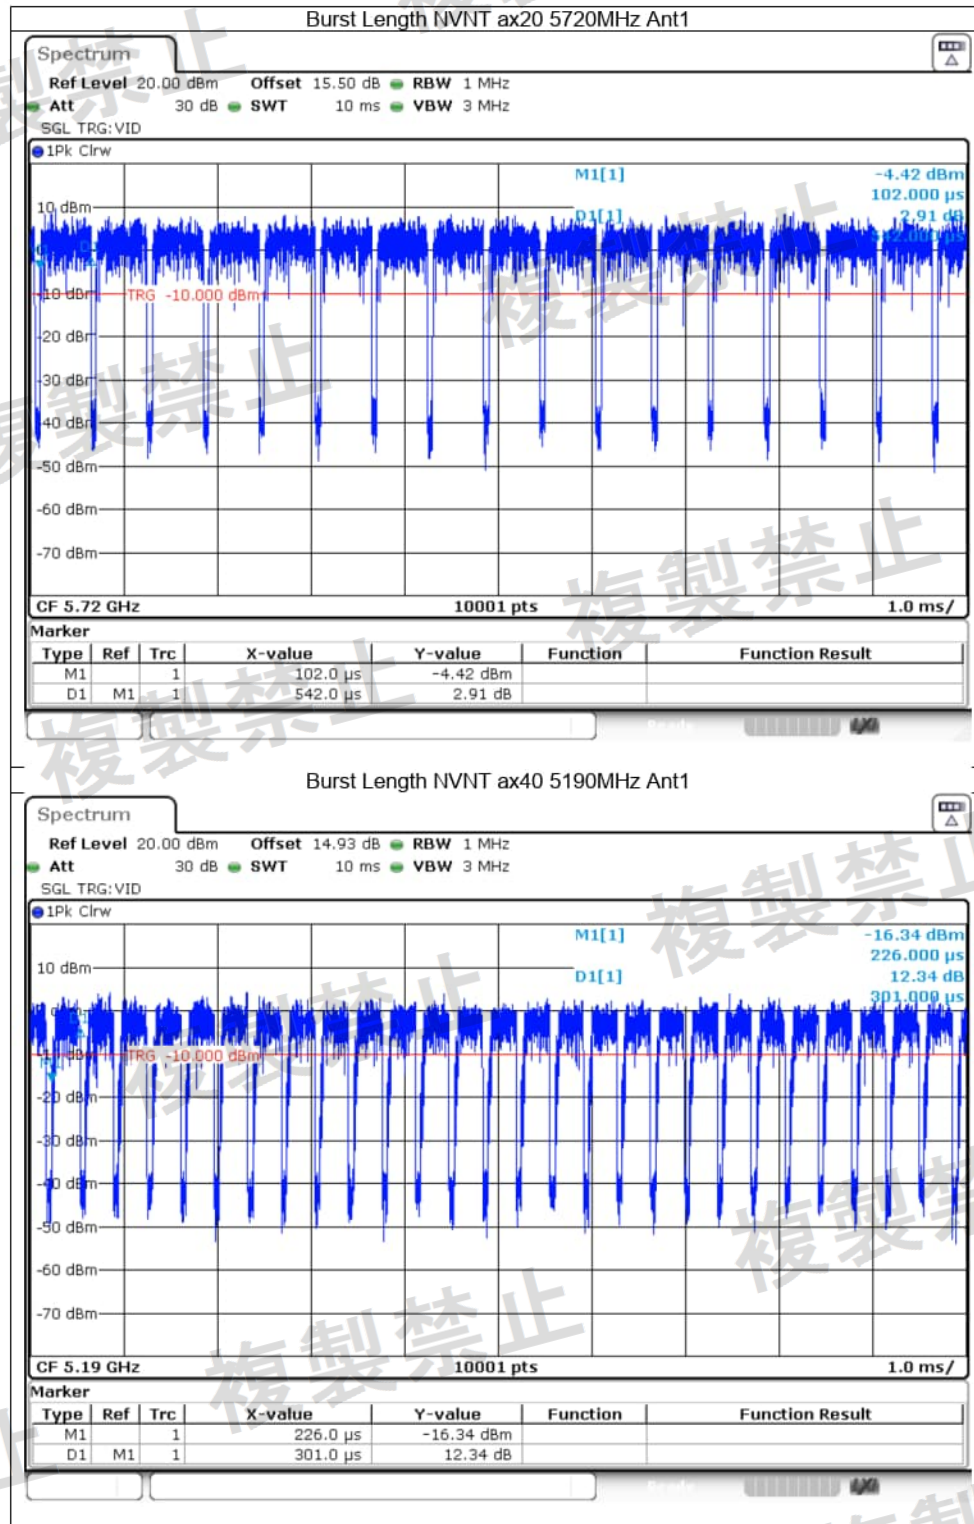


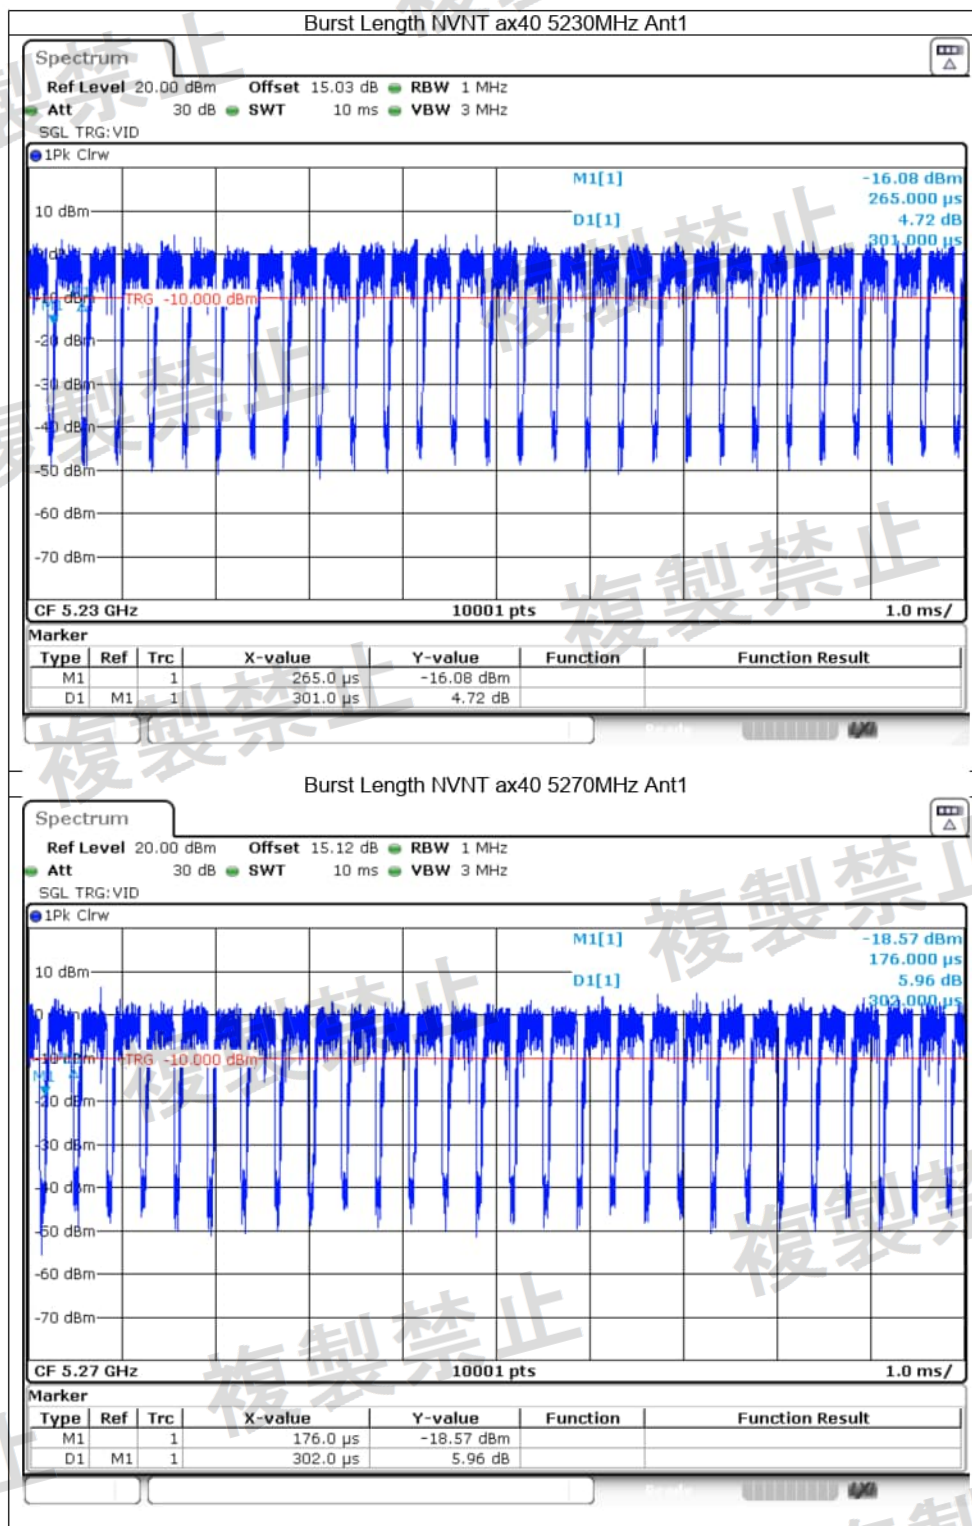


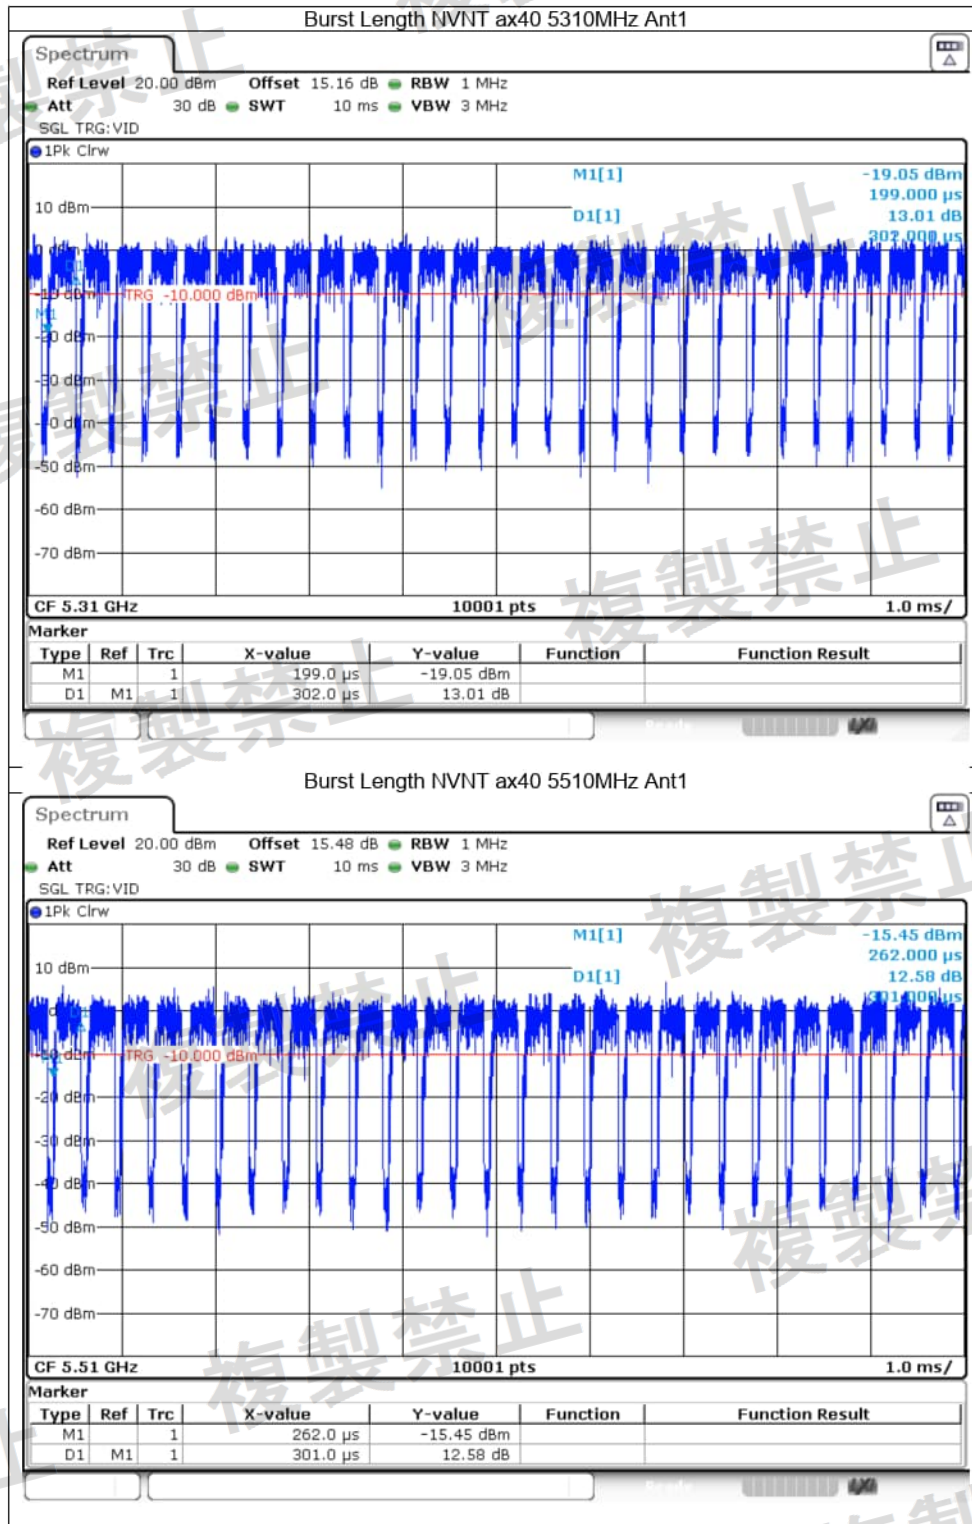

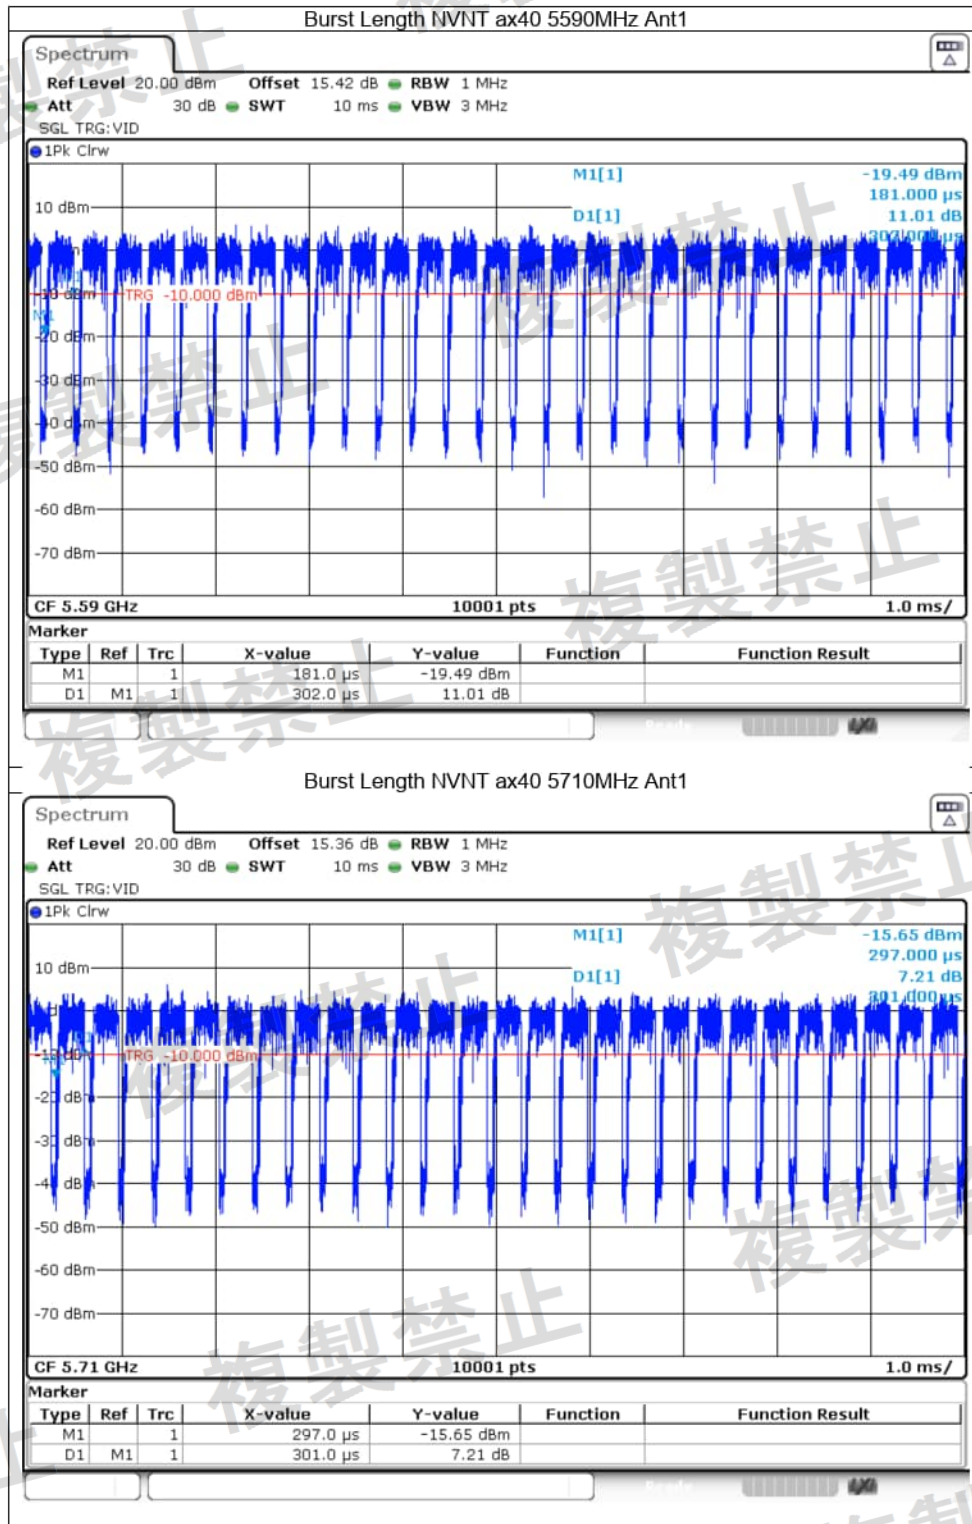

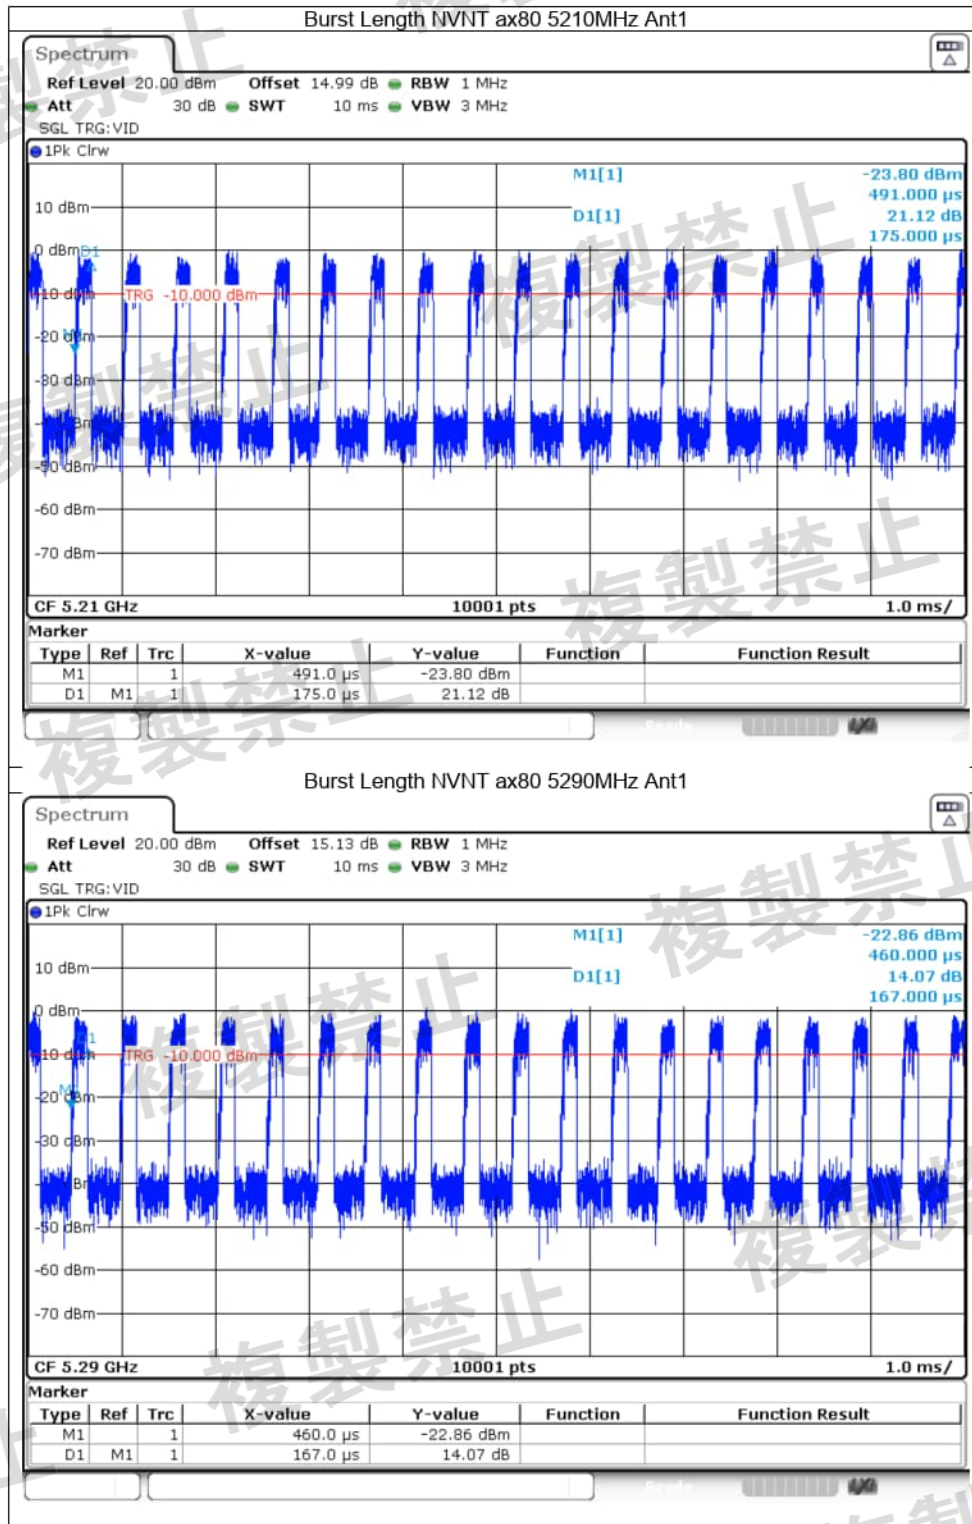


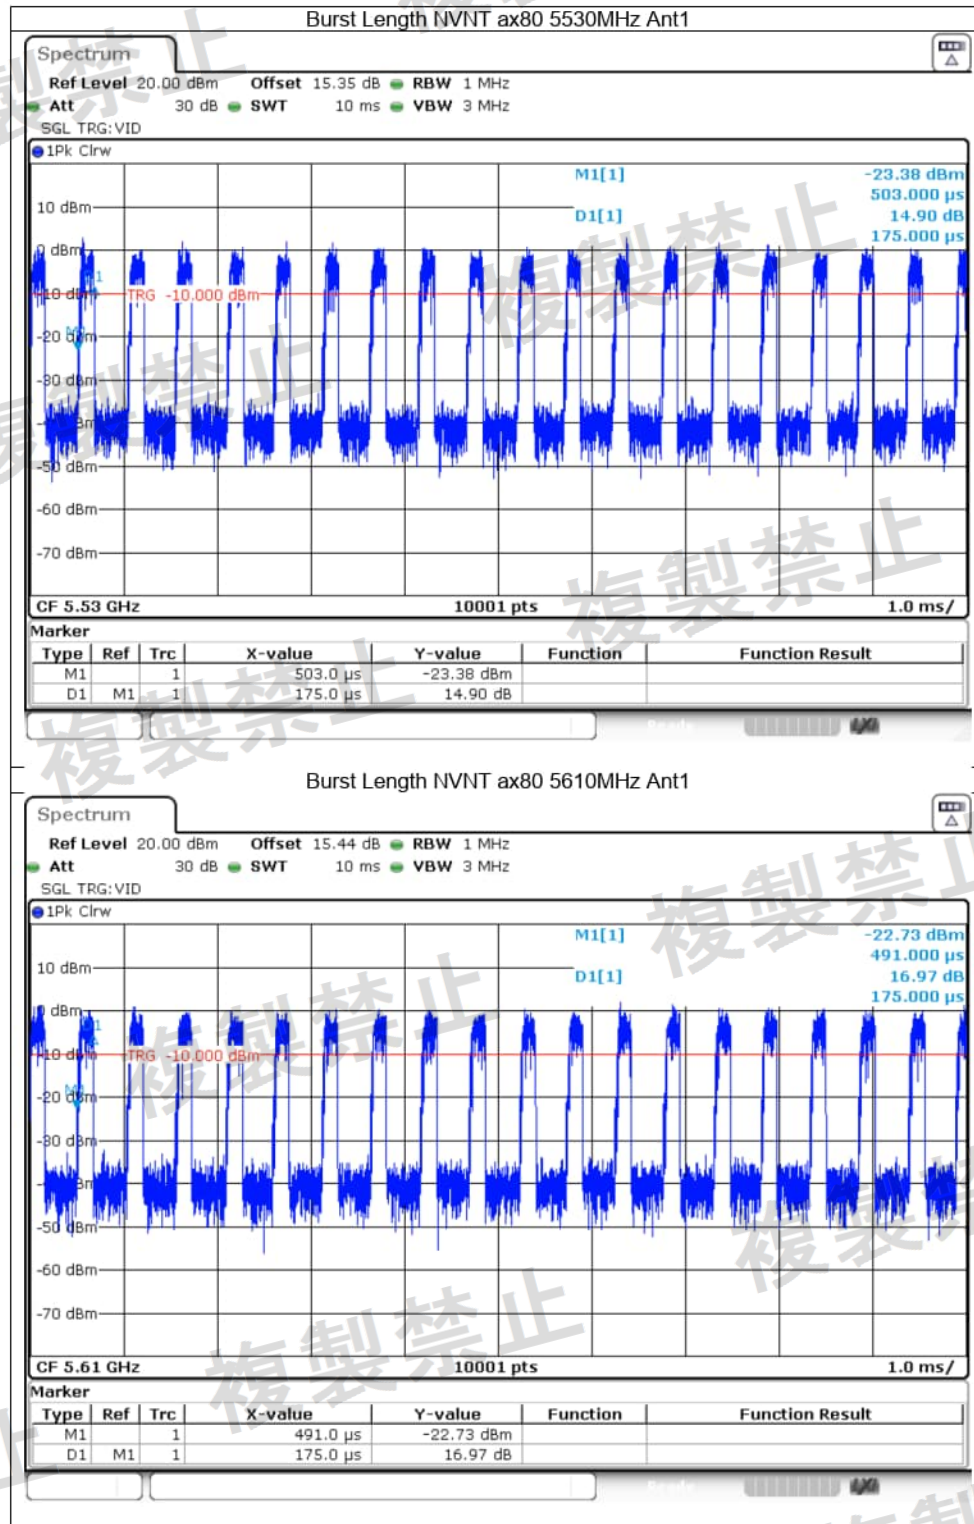

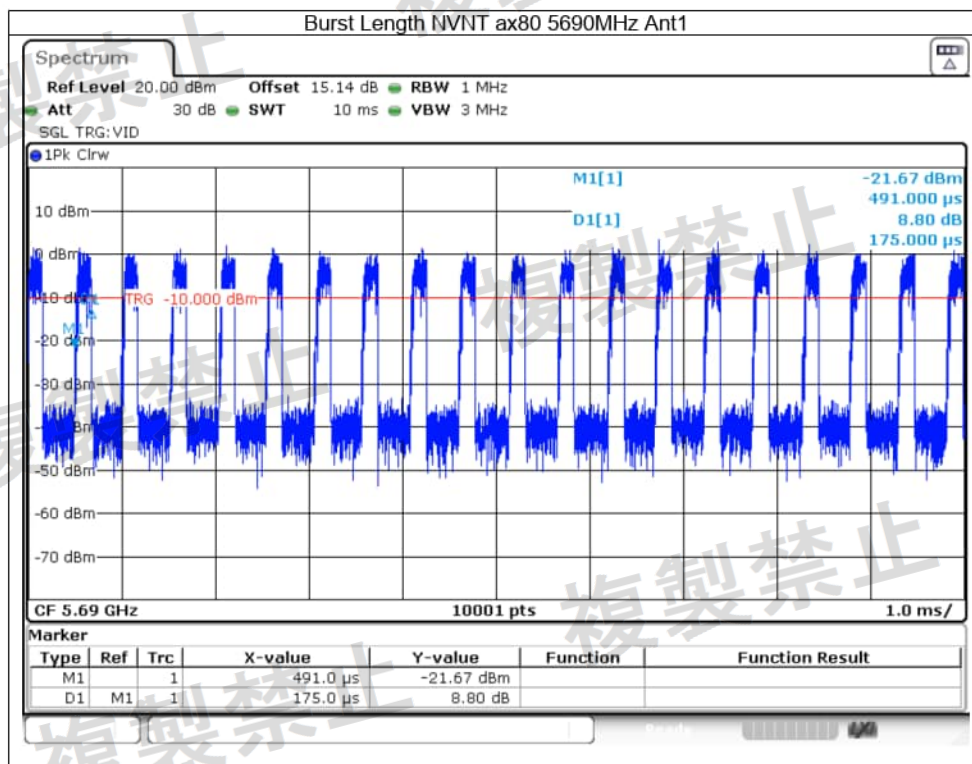


Test Graphs


Burst Length NVNT ax20 5180MHz Ant2

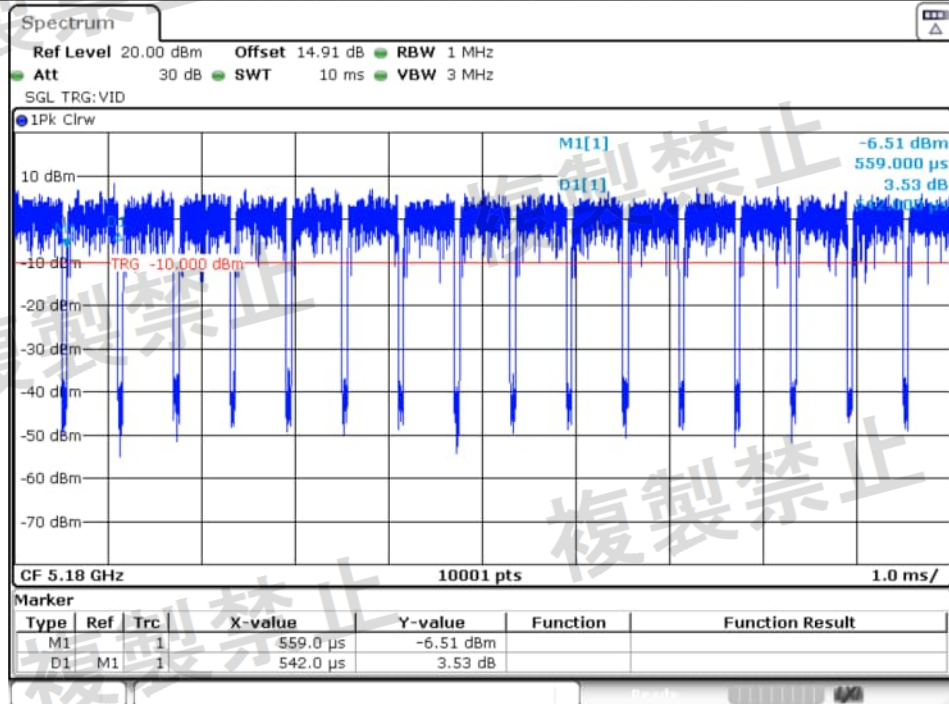


Burst Length NVNT ax20 5200MHz Ant2

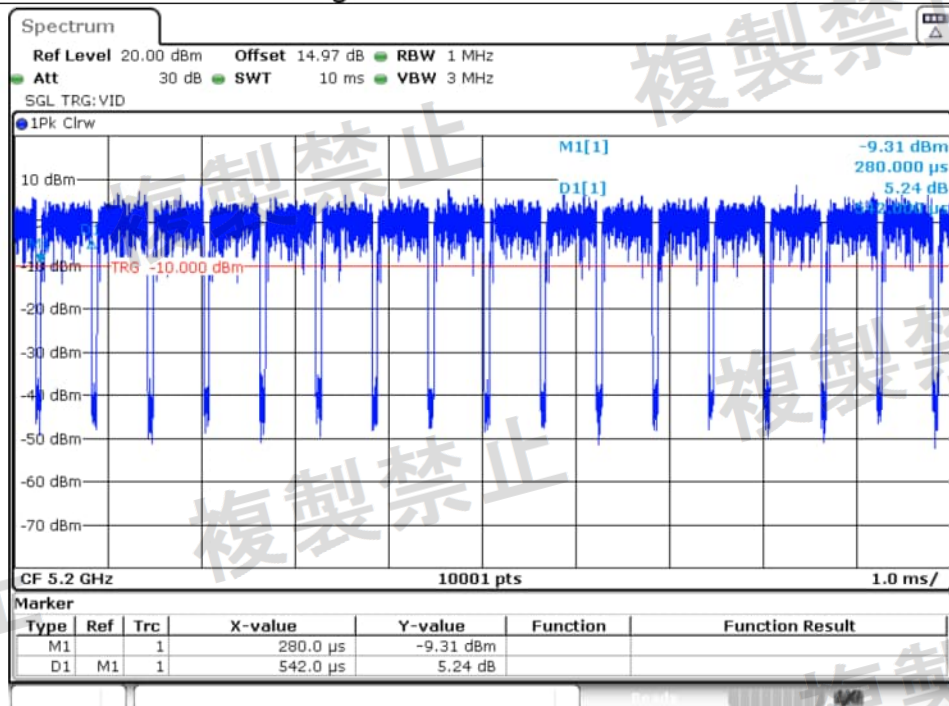


Burst Length NVNT ax20 5240MHz Ant2

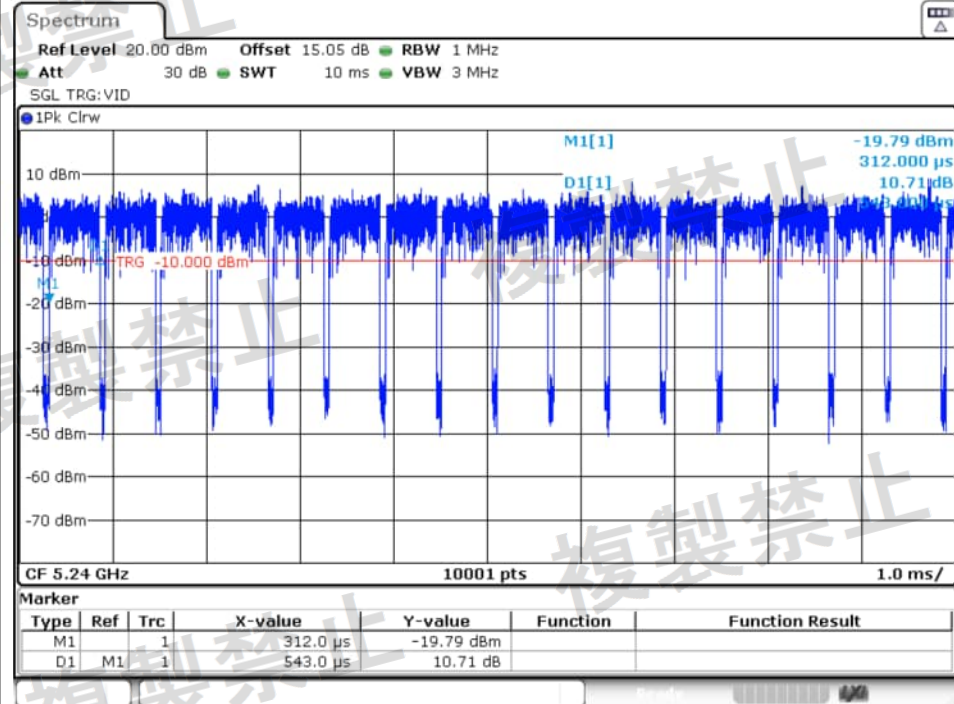


Burst Length NVNT ax20 5260MHz Ant2

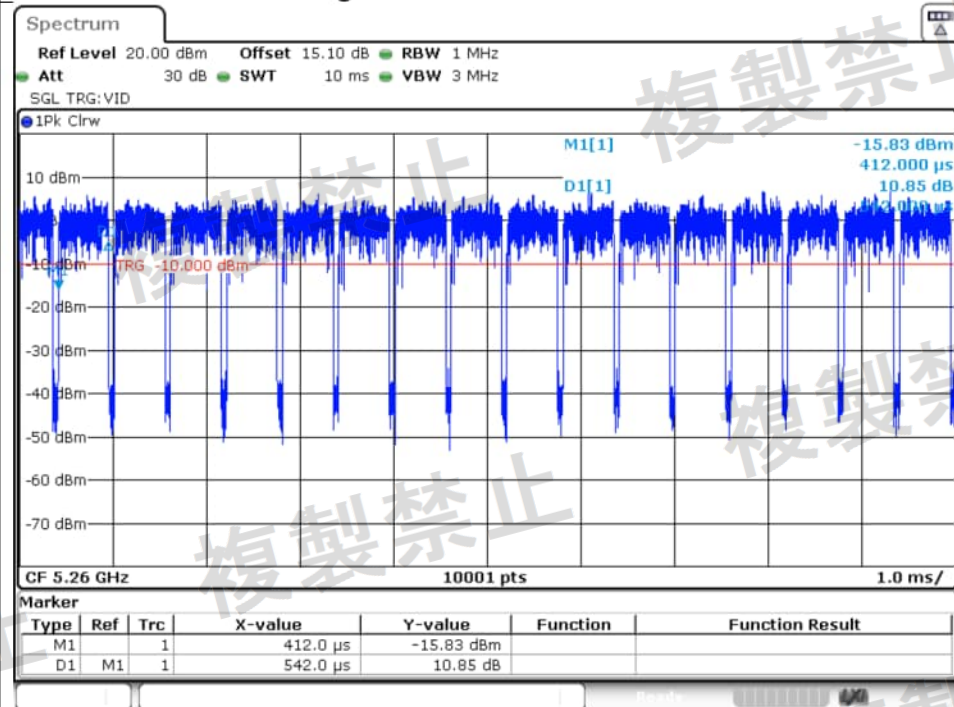


Burst Length NVNT ax20 5280MHz Ant2

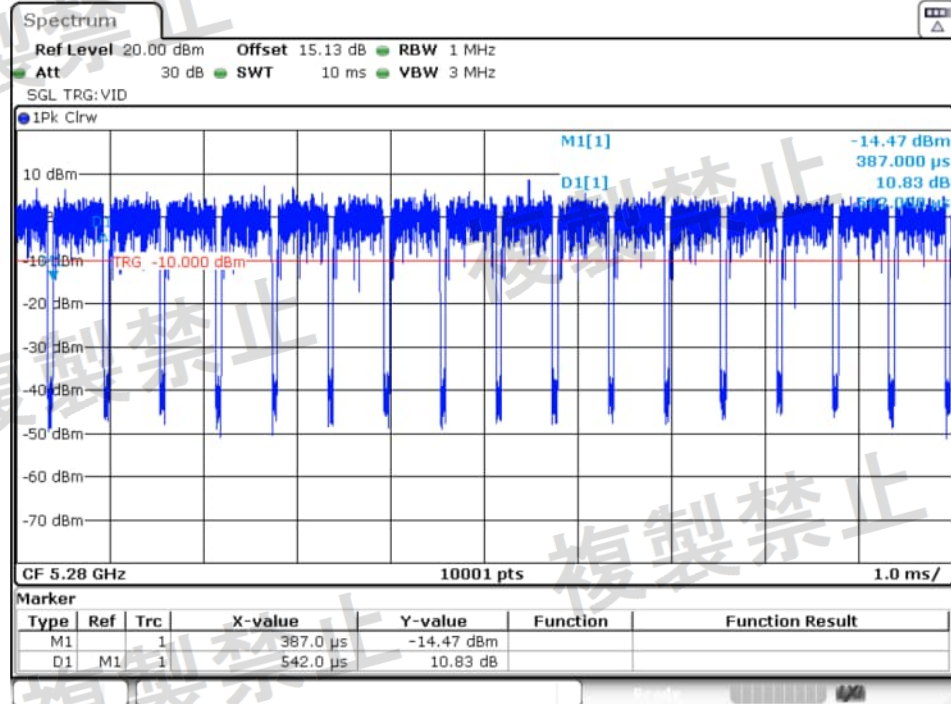


Burst Length NVNT ax20 5320MHz Ant2

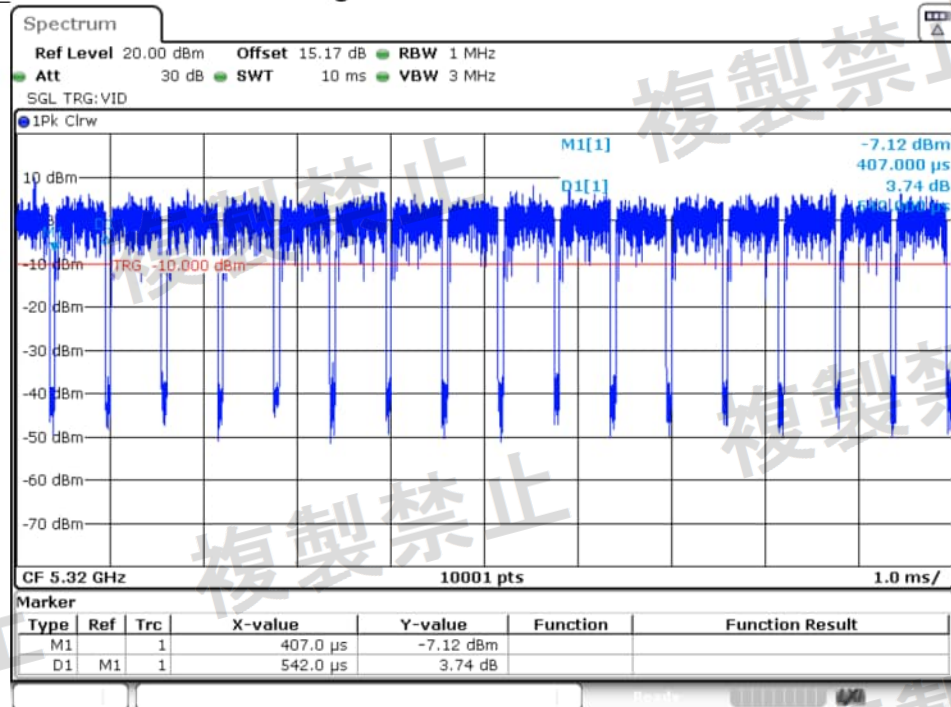

Burst Length NVNT ax20 5500MHz Ant2

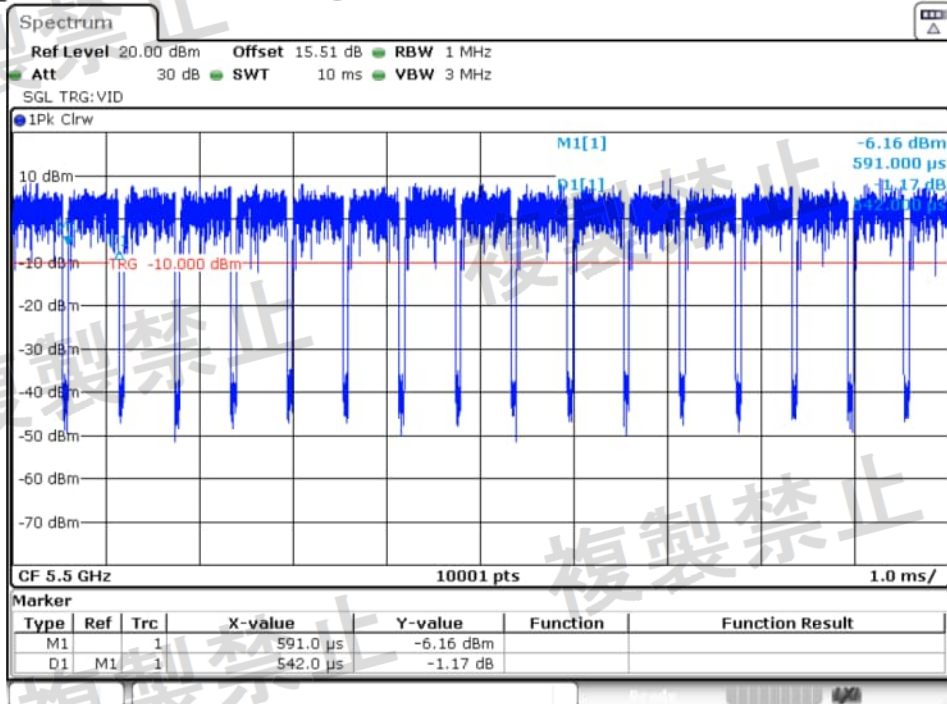


Burst Length NVNT ax20 5600MHz Ant2

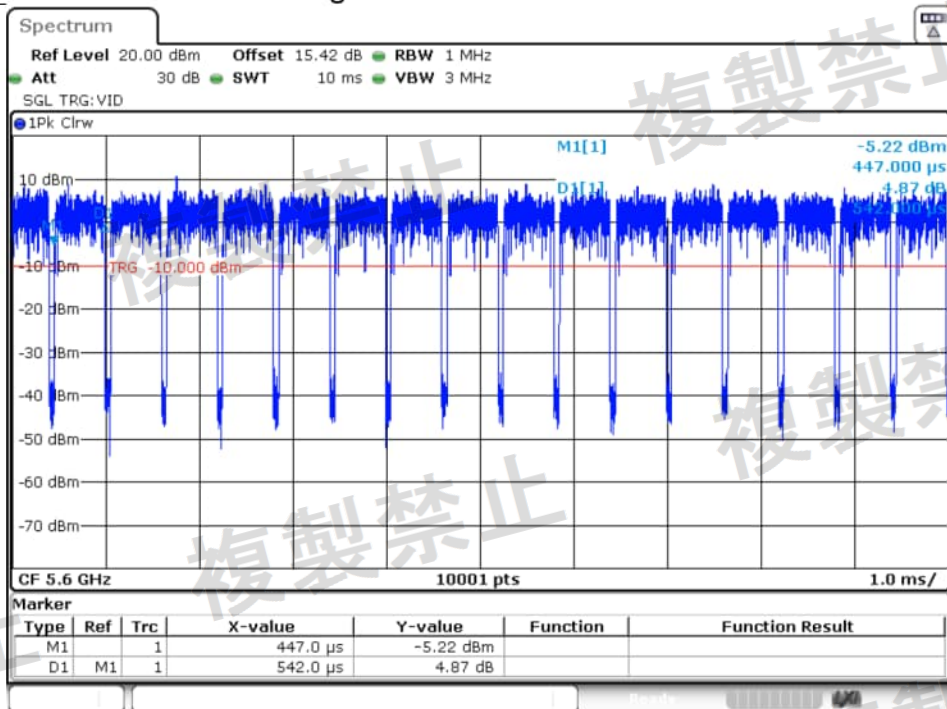




Burst Length NVNT ax20 5720MHz Ant2

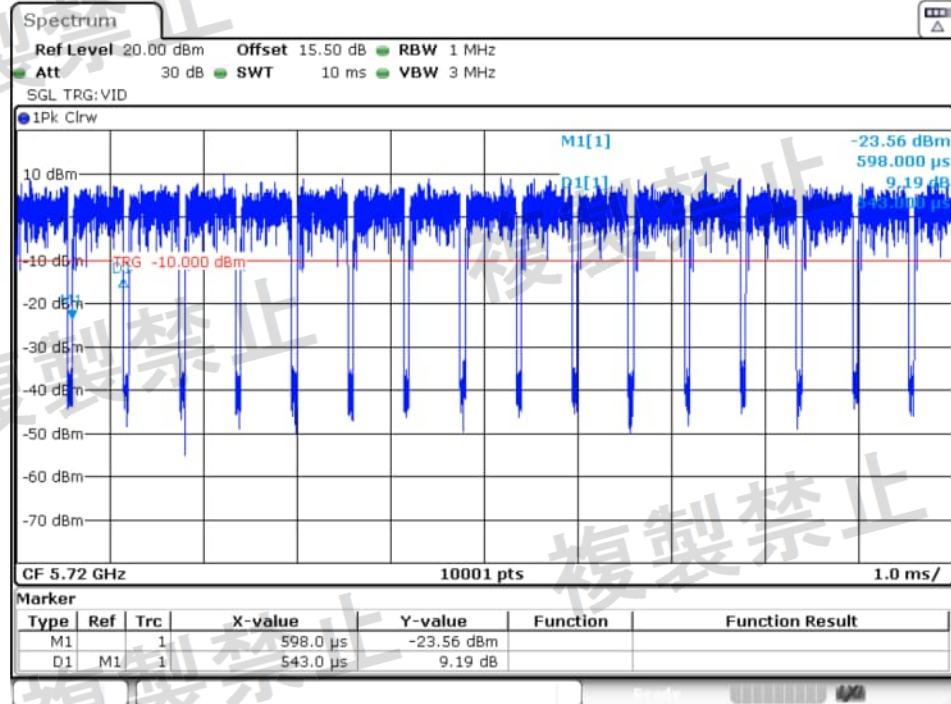


Burst Length NVNT ax40 5190MHz Ant2

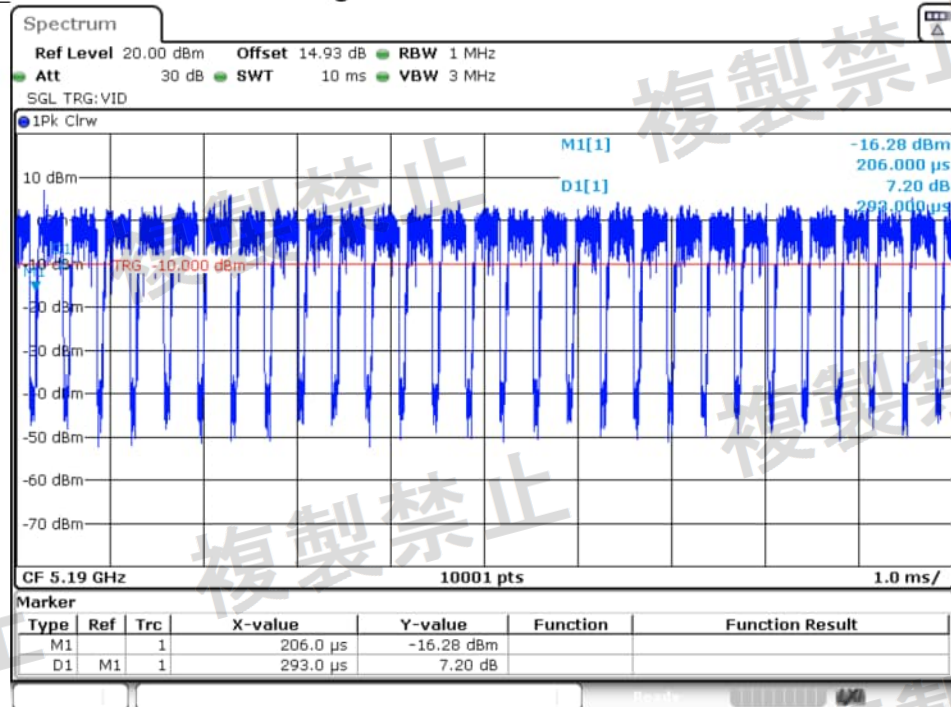





Burst Length NVNT ax40 5230MHz Ant2

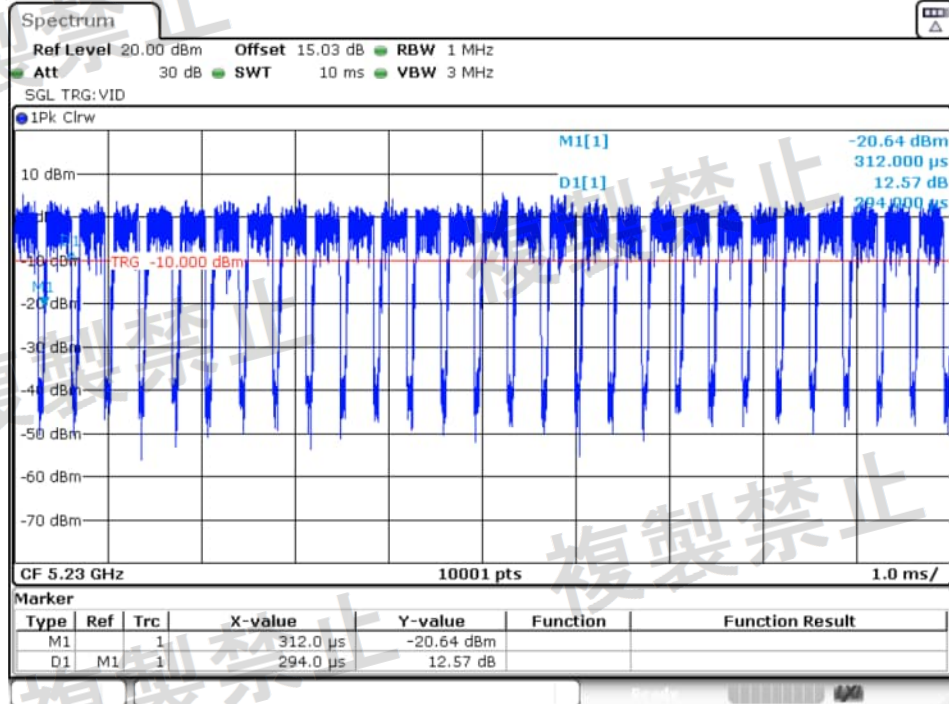

Burst Length NVNT ax40 5270MHz Ant2

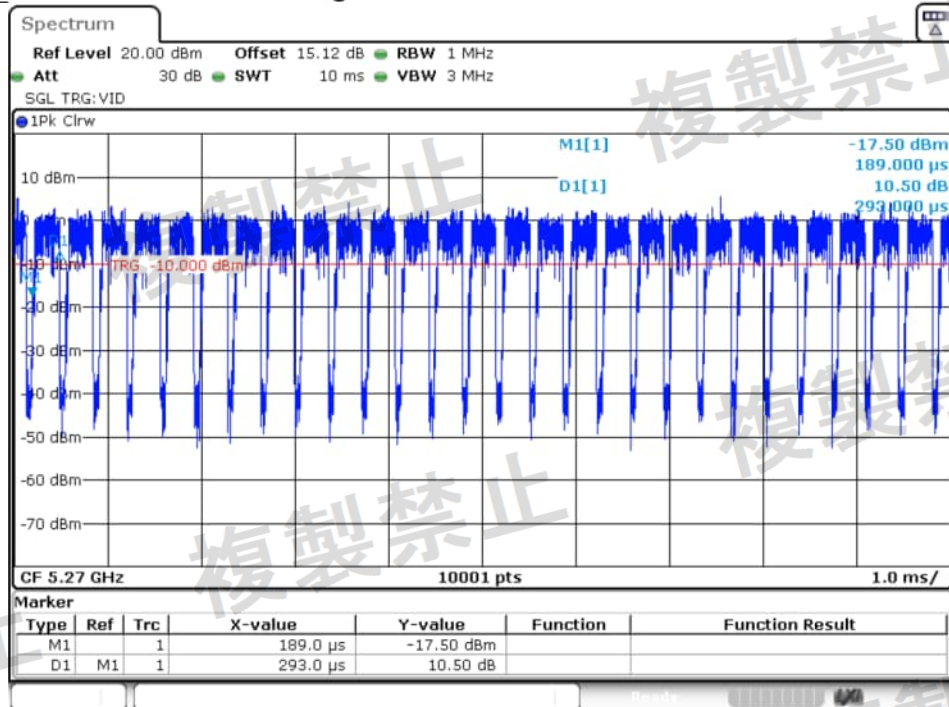

Burst Length NVNT ax40 5310MHz Ant2

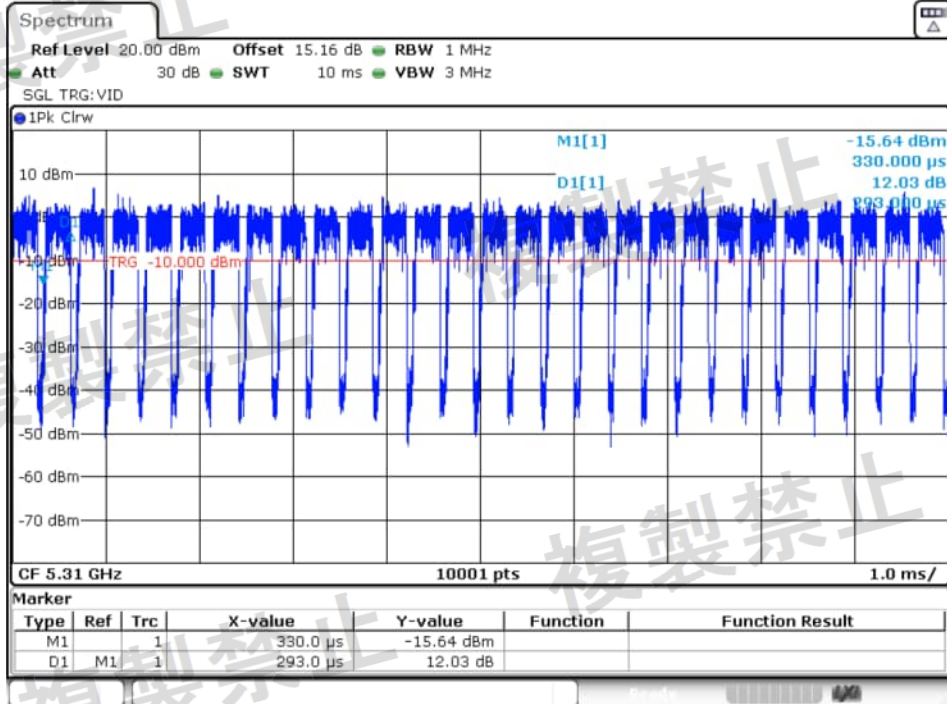

Burst Length NVNT ax40 5510MHz Ant2

