




Appendix

Frequency Error

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5180.0849	84900	16.39	20	Pass
NVNT	a	5200	Ant1	5200.0849	84900	16.33	20	Pass
NVNT	a	5240	Ant1	5240.0999	99900	19.06	20	Pass
NVNT	n40	5190	Ant1	5190.0999	99900	19.25	20	Pass
NVNT	n40	5230	Ant1	5230.0989	98900	18.91	20	Pass

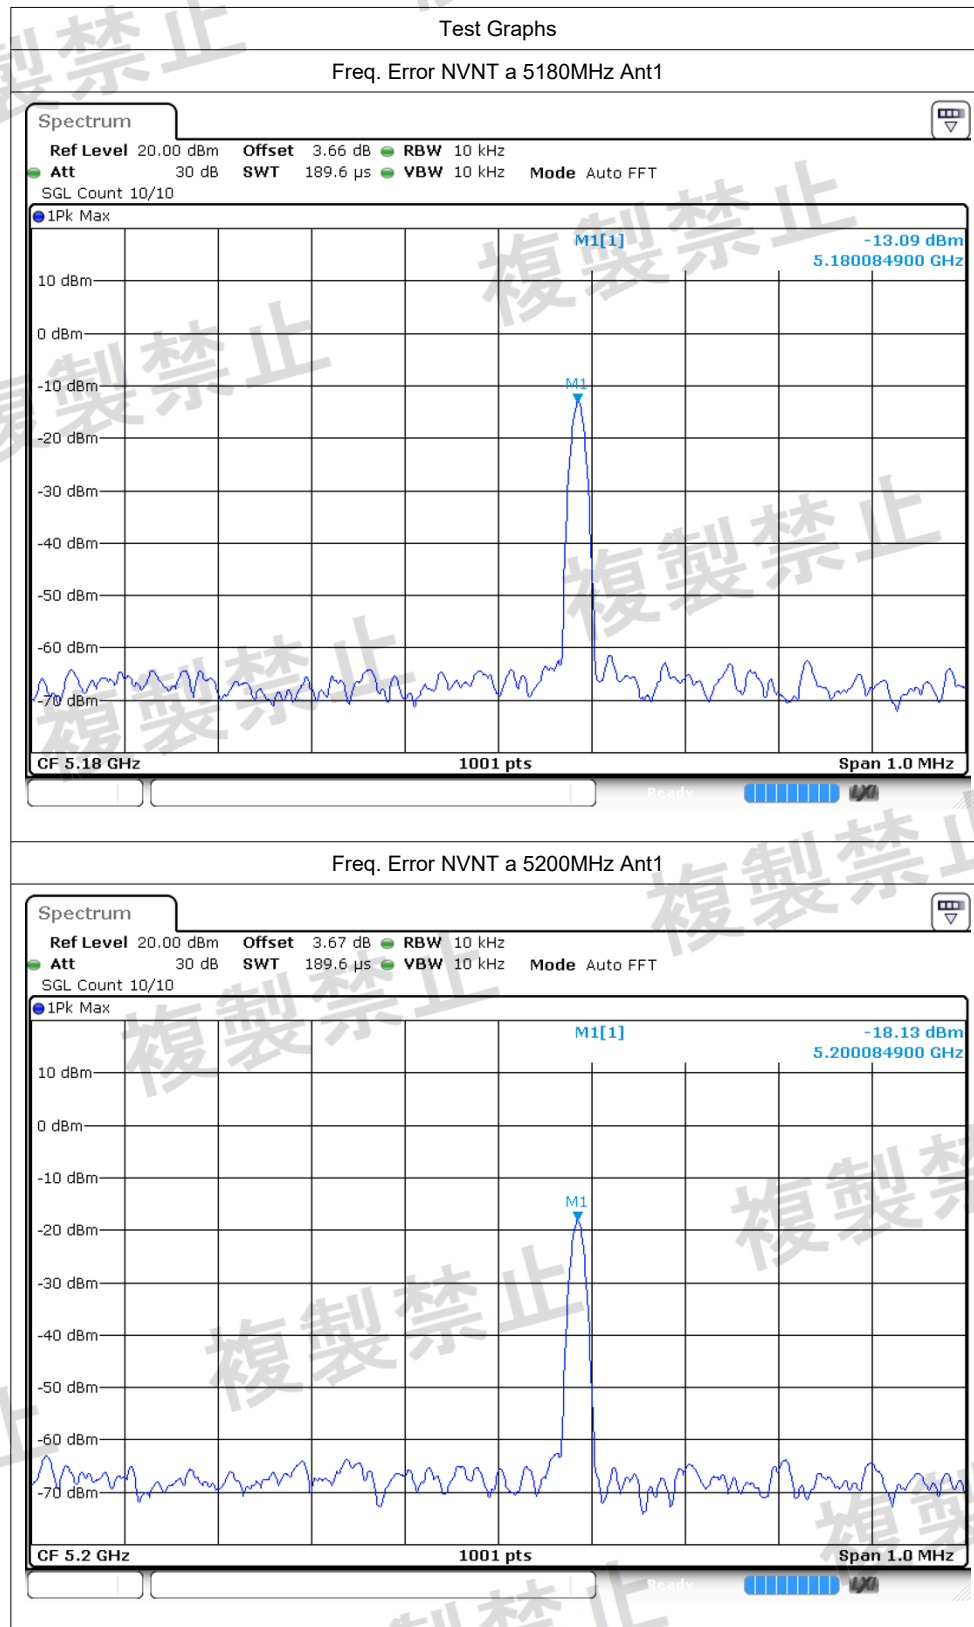


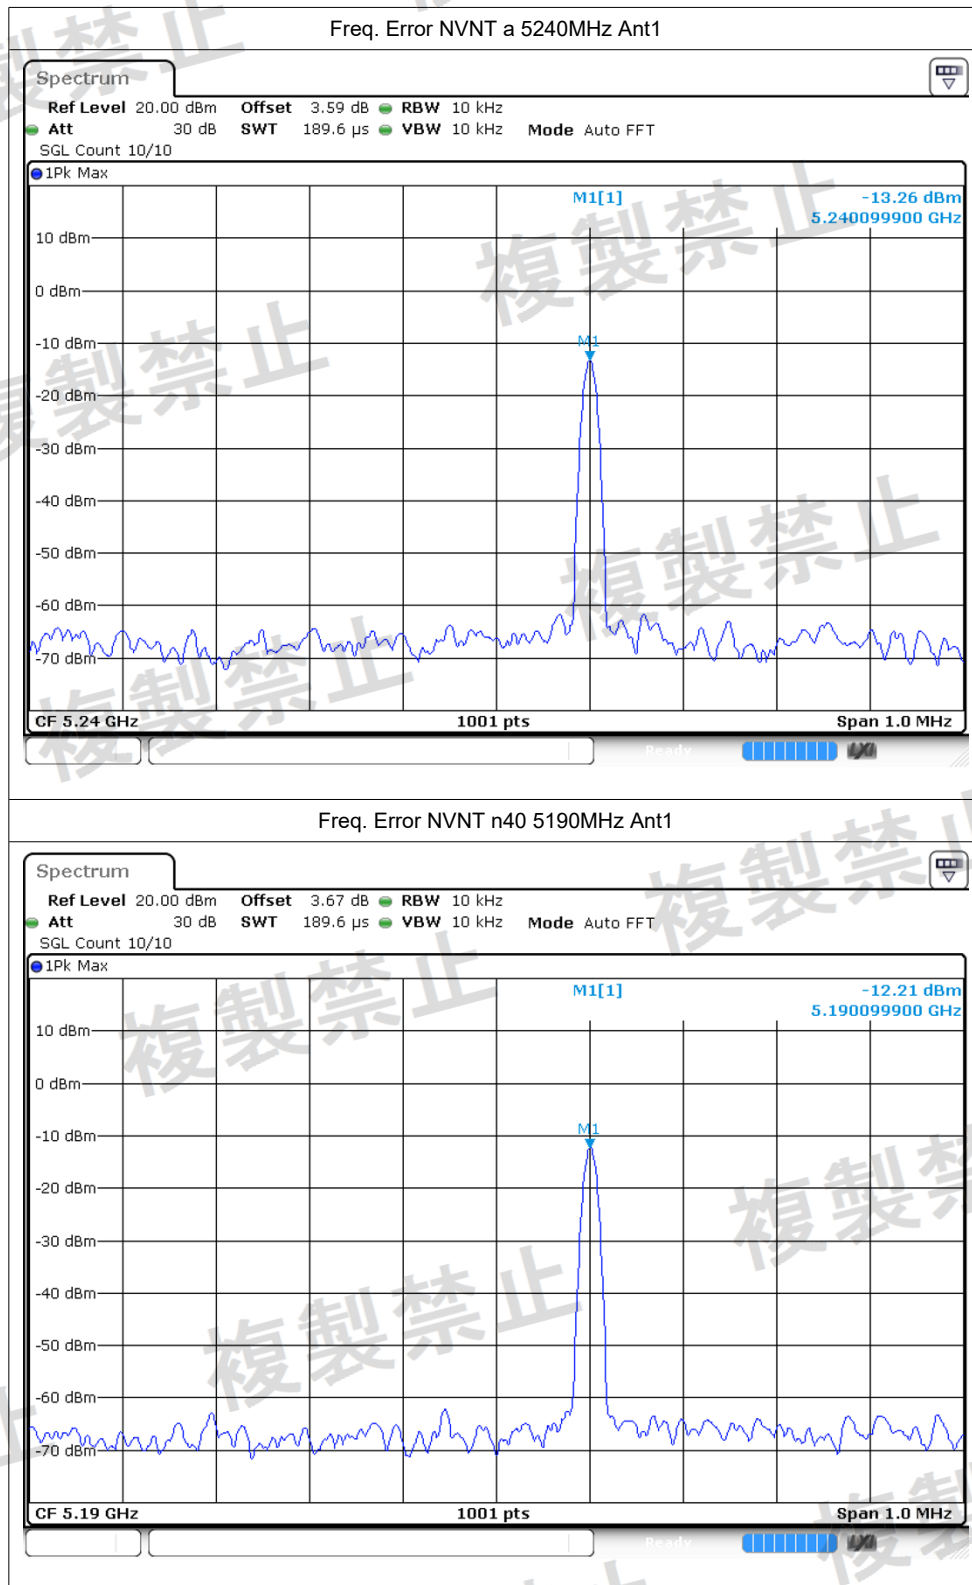


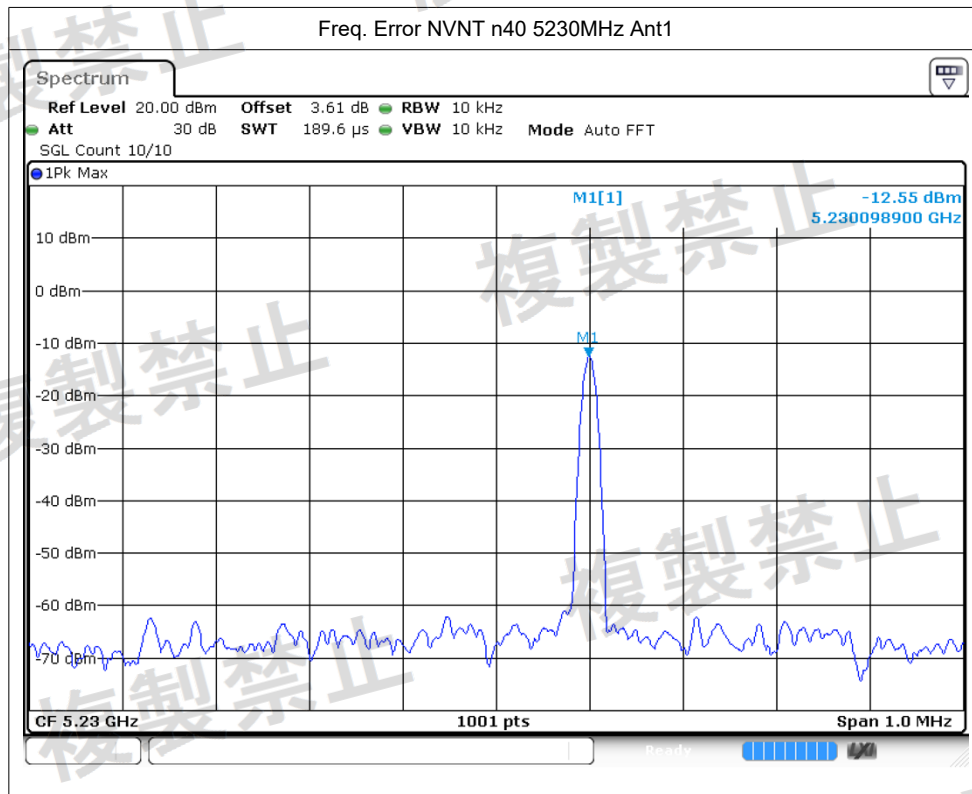



Antenna Power


Condition	Mode	Frequency (MHz)	Antenna	Power (dBm/MHz)	Power (mW/MHz)	Limit (mW/MHz)	Declared Power (mW/MHz)	Tolerance (%)	Lower Limit (%)	Upper Limit (%)	Verdict
NVNT	a	5180	Ant1	-3.16	0.483	10	1	-51.69	-80	20	Pass
NVNT	a	5200	Ant1	-3.95	0.403	10	1	-59.73	-80	20	Pass
NVNT	a	5240	Ant1	-4.13	0.386	10	1	-61.36	-80	20	Pass
NVNT	n20	5180	Ant1	-4.67	0.341	10	0.5	-31.76	-80	20	Pass
NVNT	n20	5200	Ant1	-4.38	0.365	10	0.5	-27.05	-80	20	Pass
NVNT	n20	5240	Ant1	-5.85	0.26	10	0.5	-48	-80	20	Pass
NVNT	n40	5190	Ant1	-7.11	0.195	5	0.5	-61.09	-80	20	Pass
NVNT	n40	5230	Ant1	-8.2	0.151	5	0.5	-69.73	-80	20	Pass
NVNT	ac20	5180	Ant1	-4.31	0.371	10	0.5	-25.86	-80	20	Pass
NVNT	ac20	5200	Ant1	-4.59	0.348	10	0.5	-30.49	-80	20	Pass
NVNT	ac20	5240	Ant1	-5	0.316	10	0.5	-36.75	-80	20	Pass
NVNT	ac40	5190	Ant1	-7.06	0.197	5	0.5	-60.64	-80	20	Pass
NVNT	ac40	5230	Ant1	-7.9	0.162	5	0.5	-67.56	-80	20	Pass
NVNT	ax20	5180	Ant1	-4.42	0.361	10	0.5	-27.72	-80	20	Pass
NVNT	ax20	5200	Ant1	-4.63	0.344	10	0.5	-31.13	-80	20	Pass
NVNT	ax20	5240	Ant1	-5.64	0.273	10	0.5	-45.42	-80	20	Pass
NVNT	ax40	5190	Ant1	-7.14	0.193	5	0.5	-61.36	-80	20	Pass
NVNT	ax40	5230	Ant1	-8.19	0.152	5	0.5	-69.66	-80	20	Pass

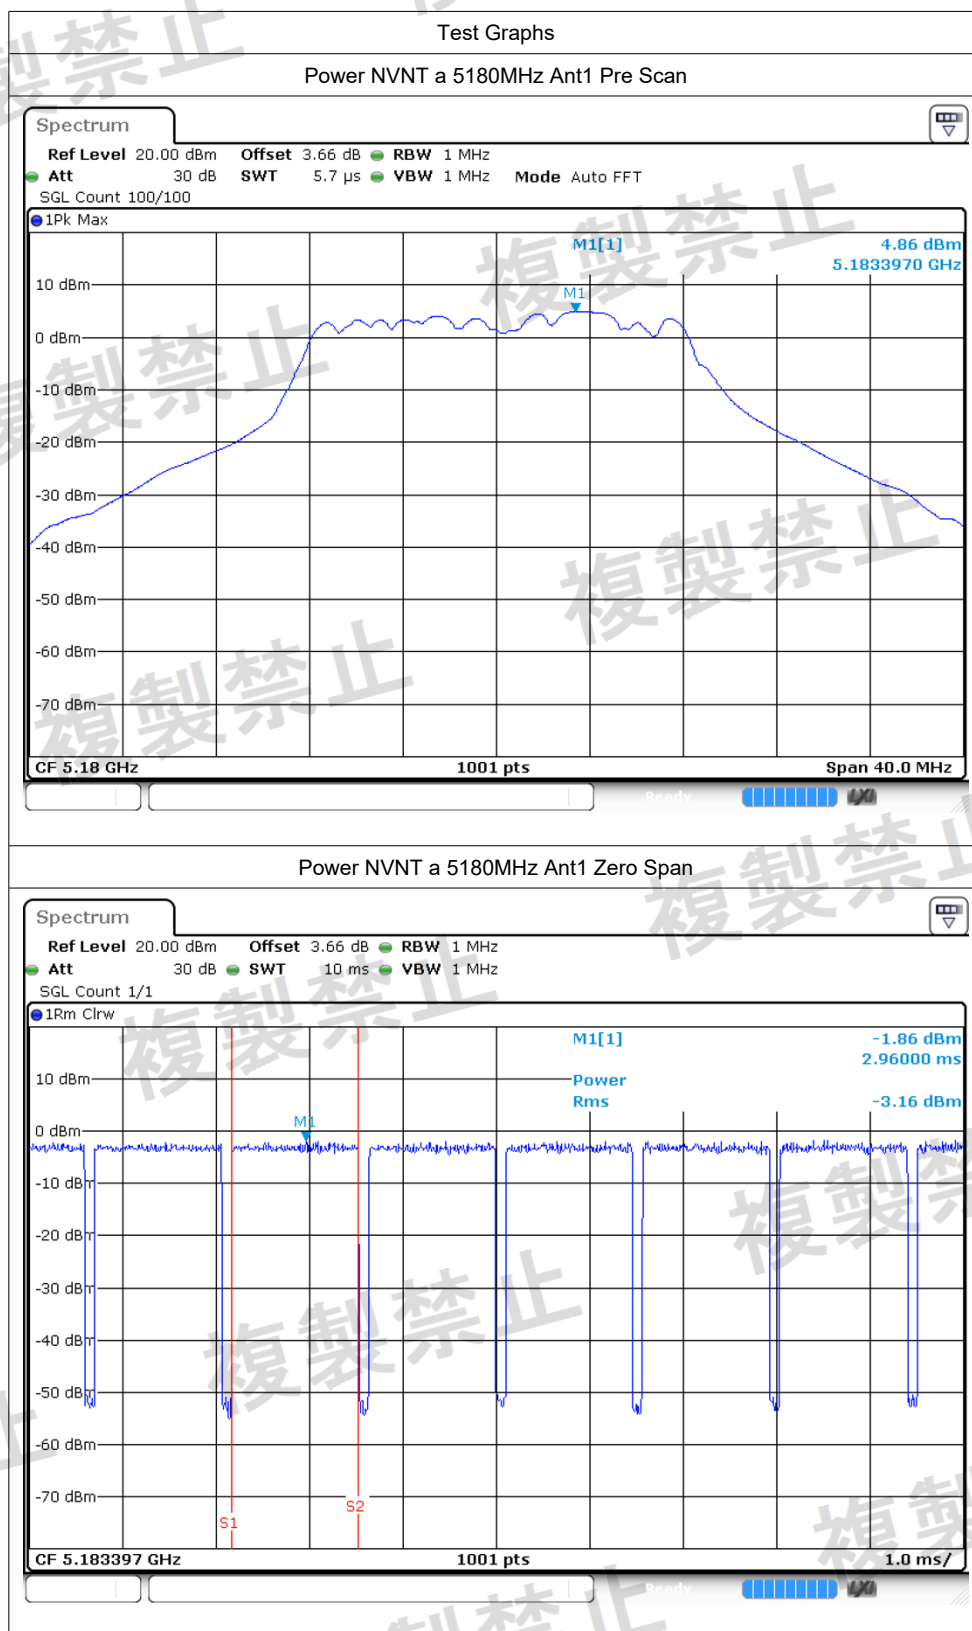


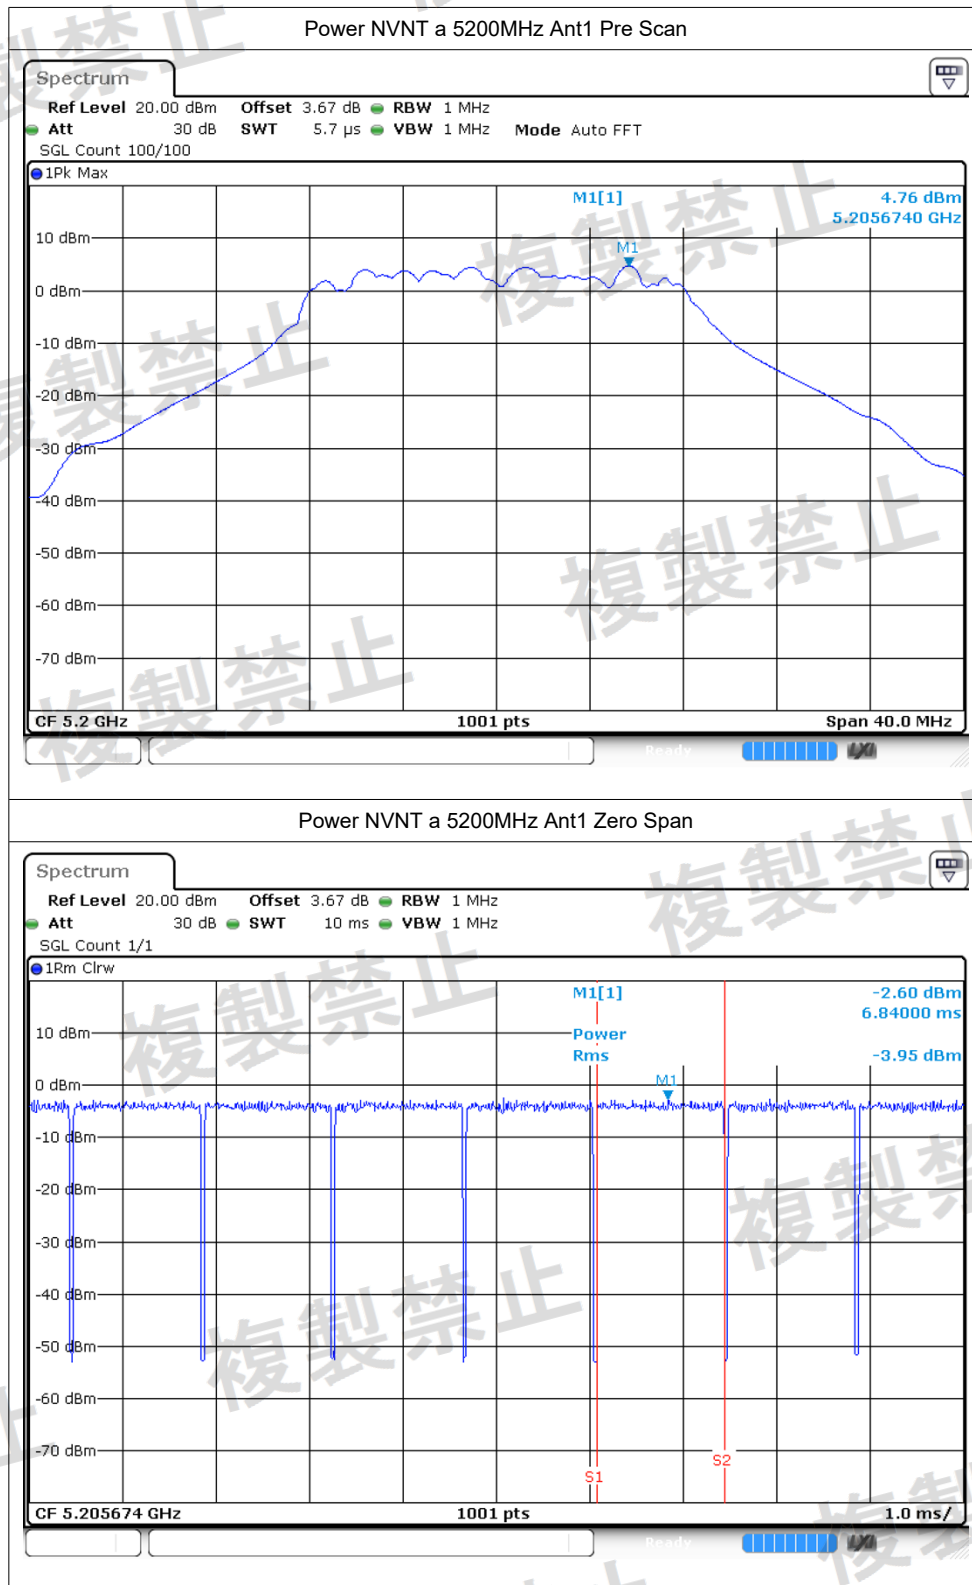


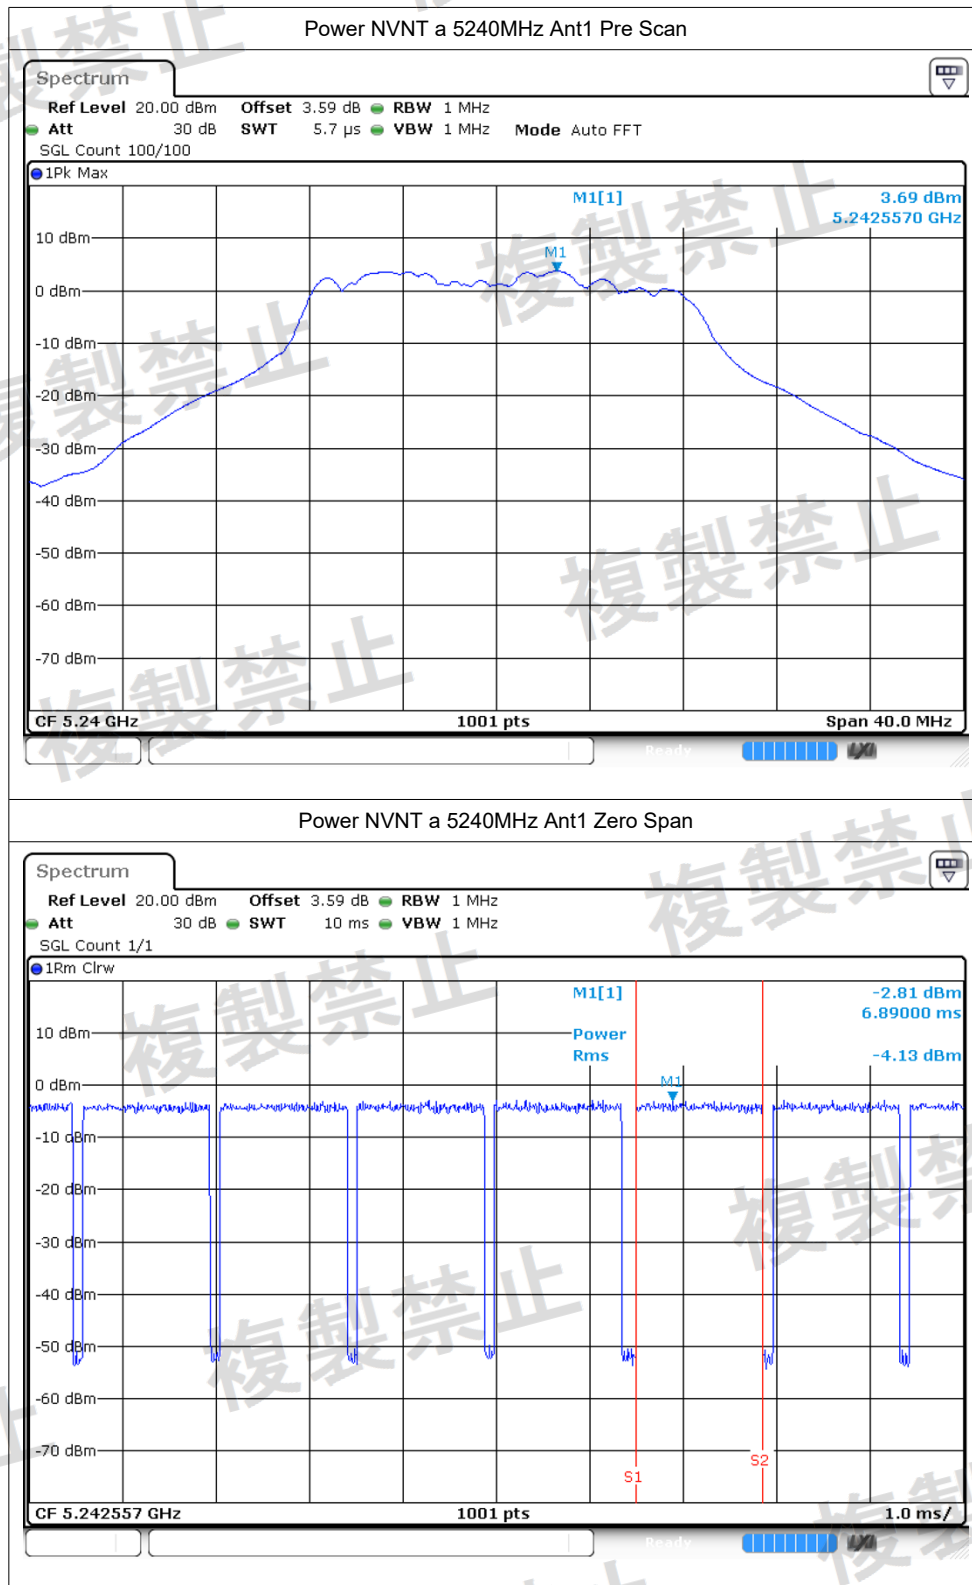


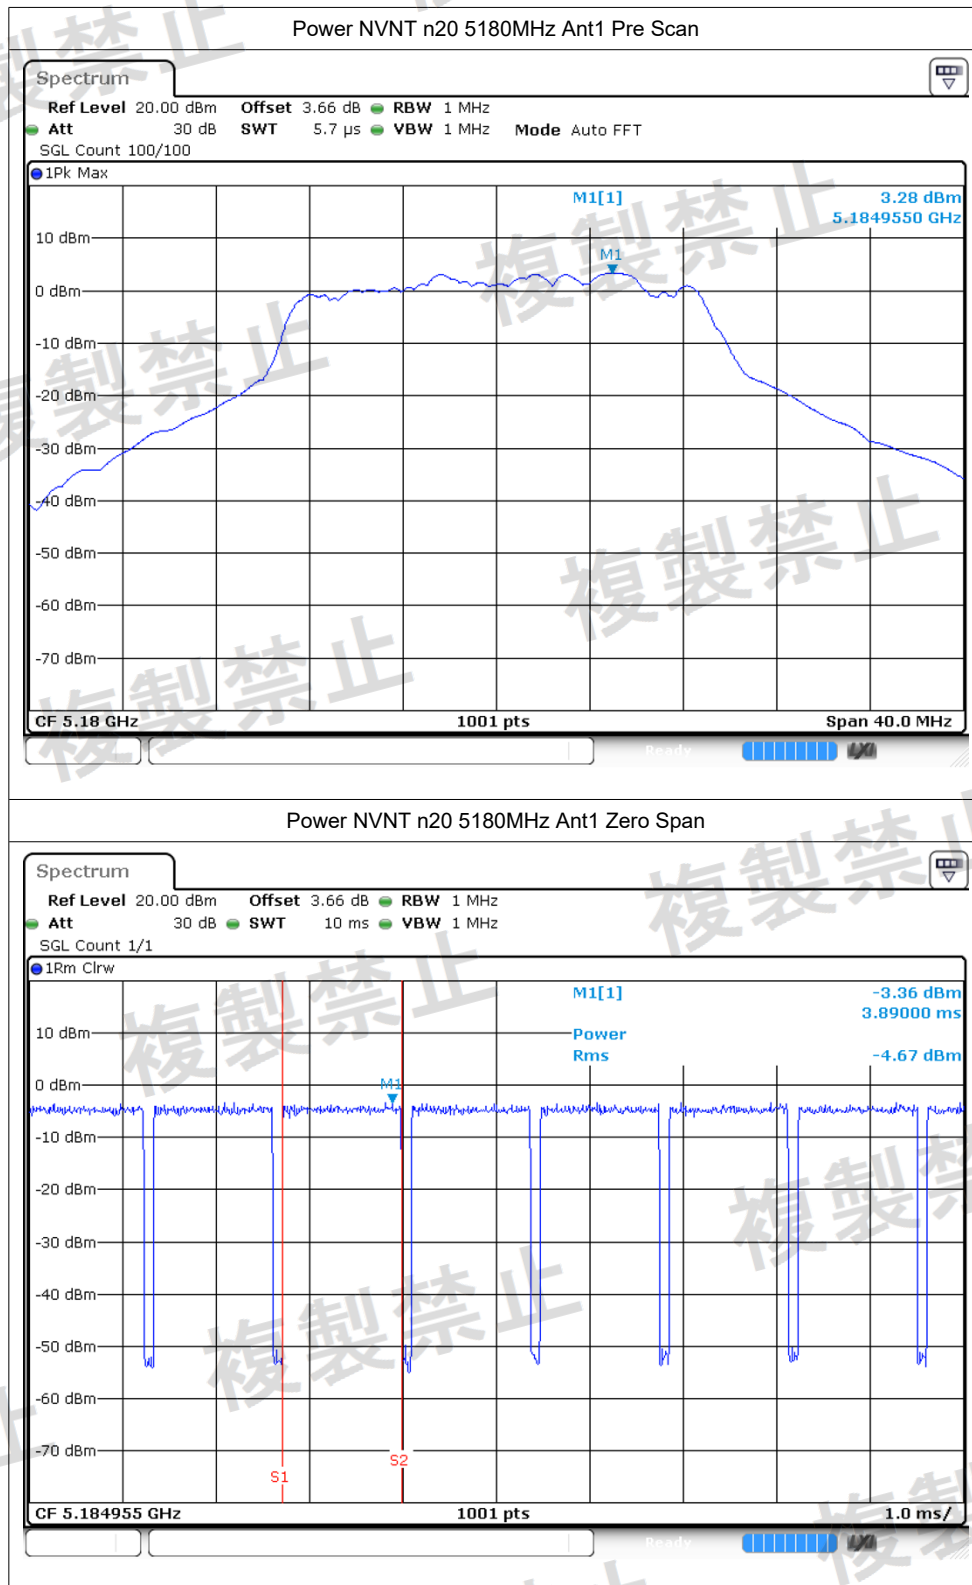


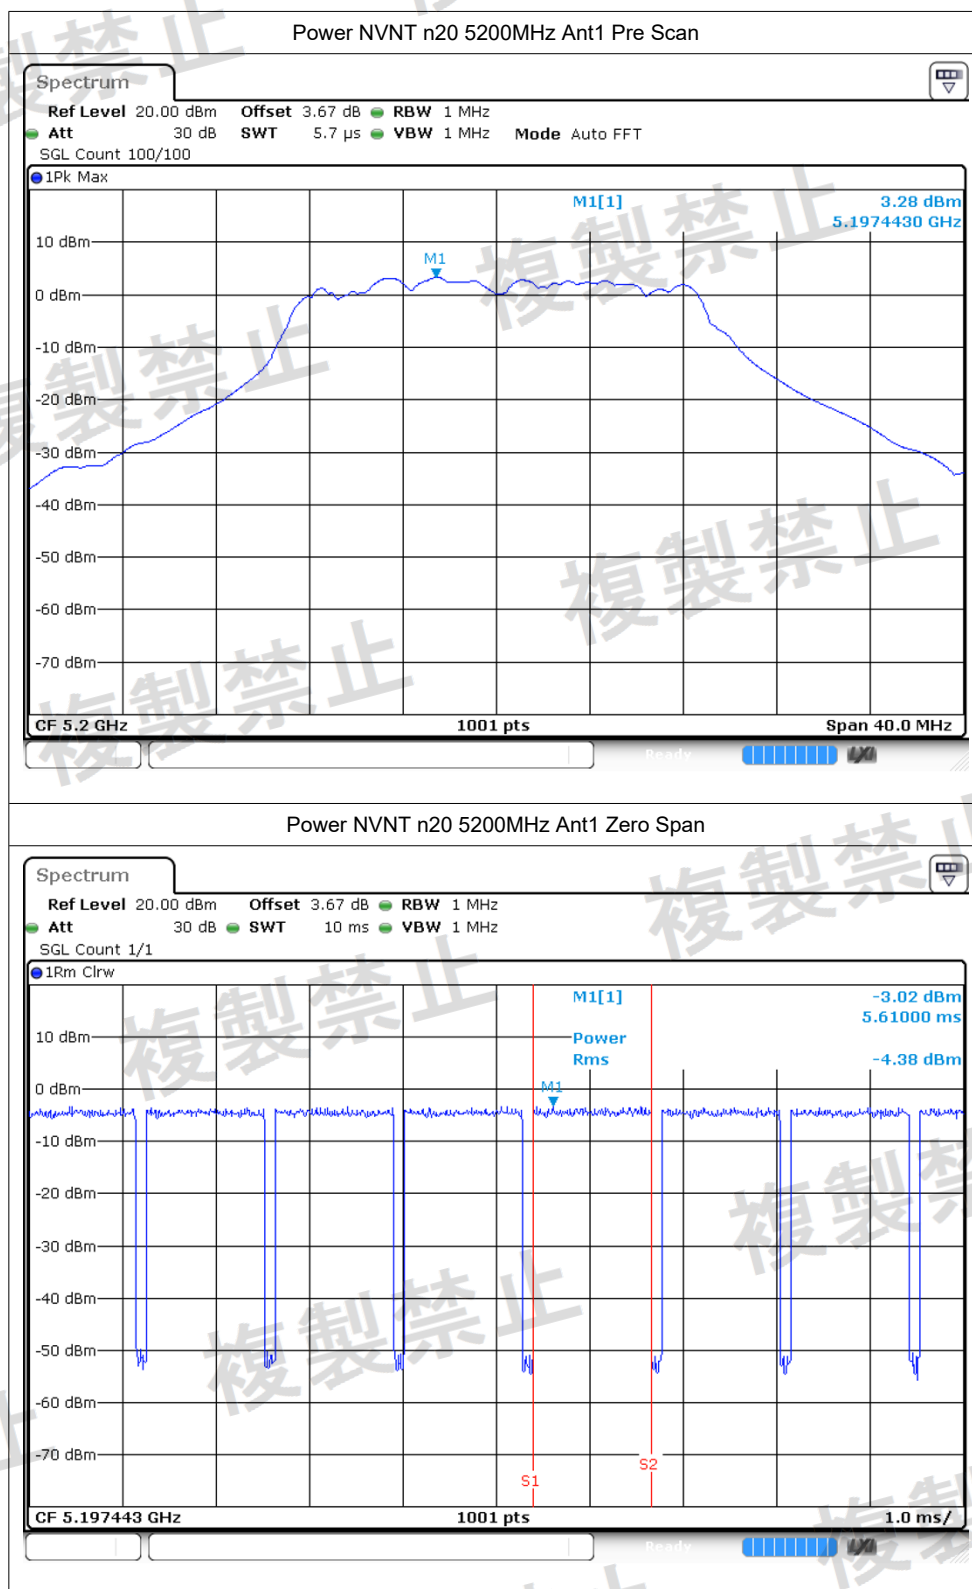


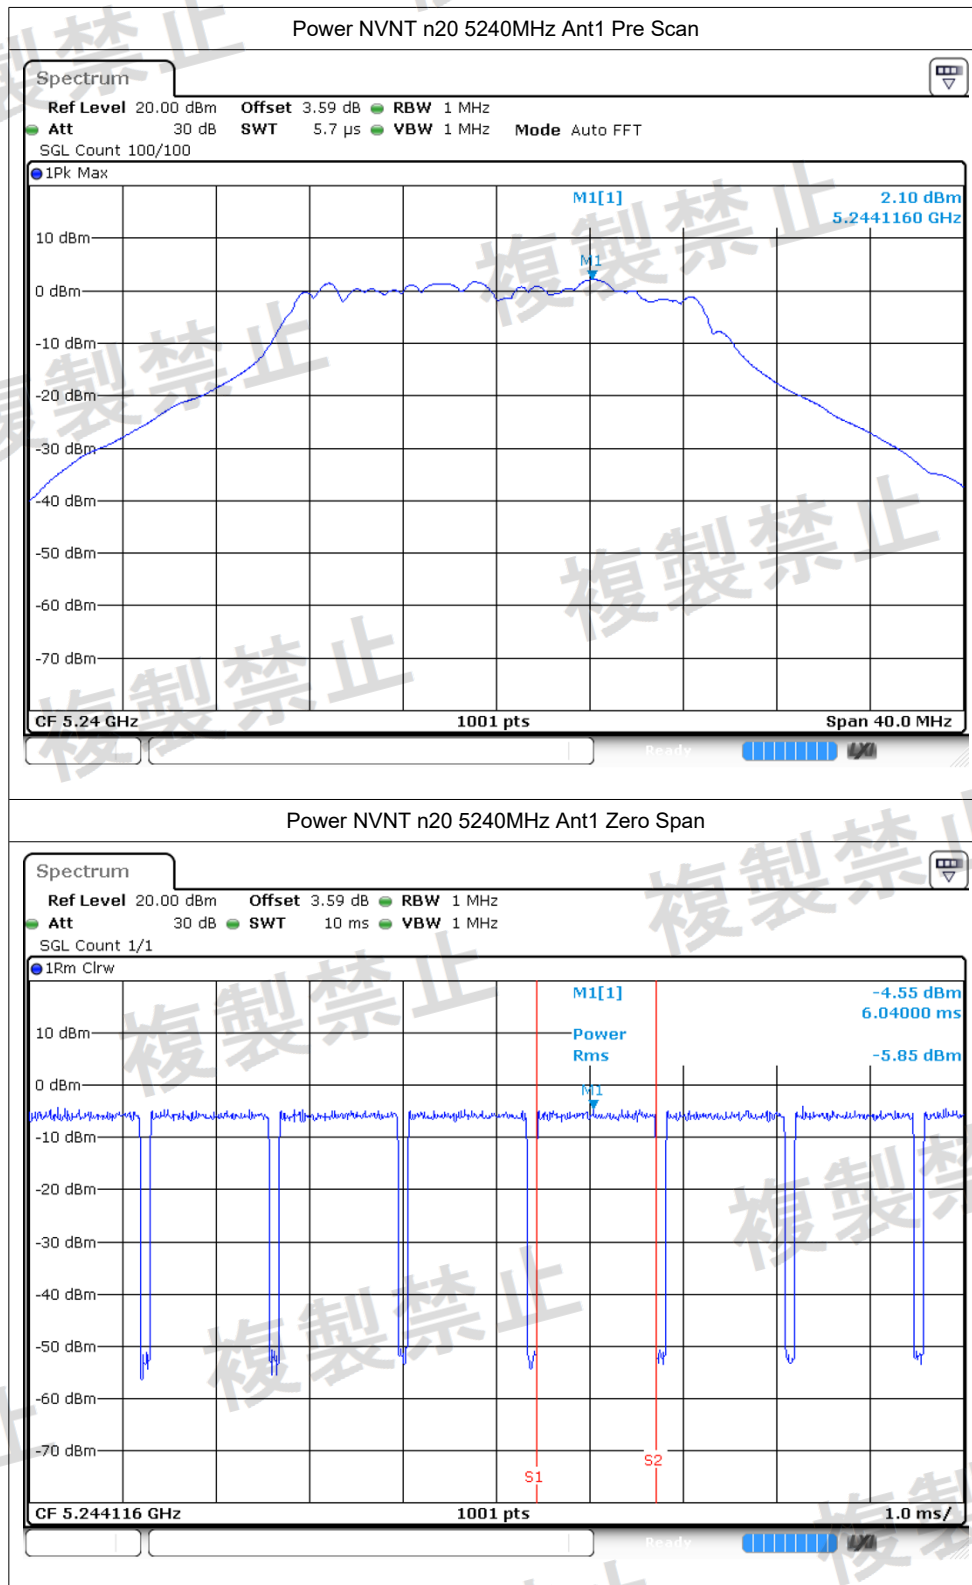


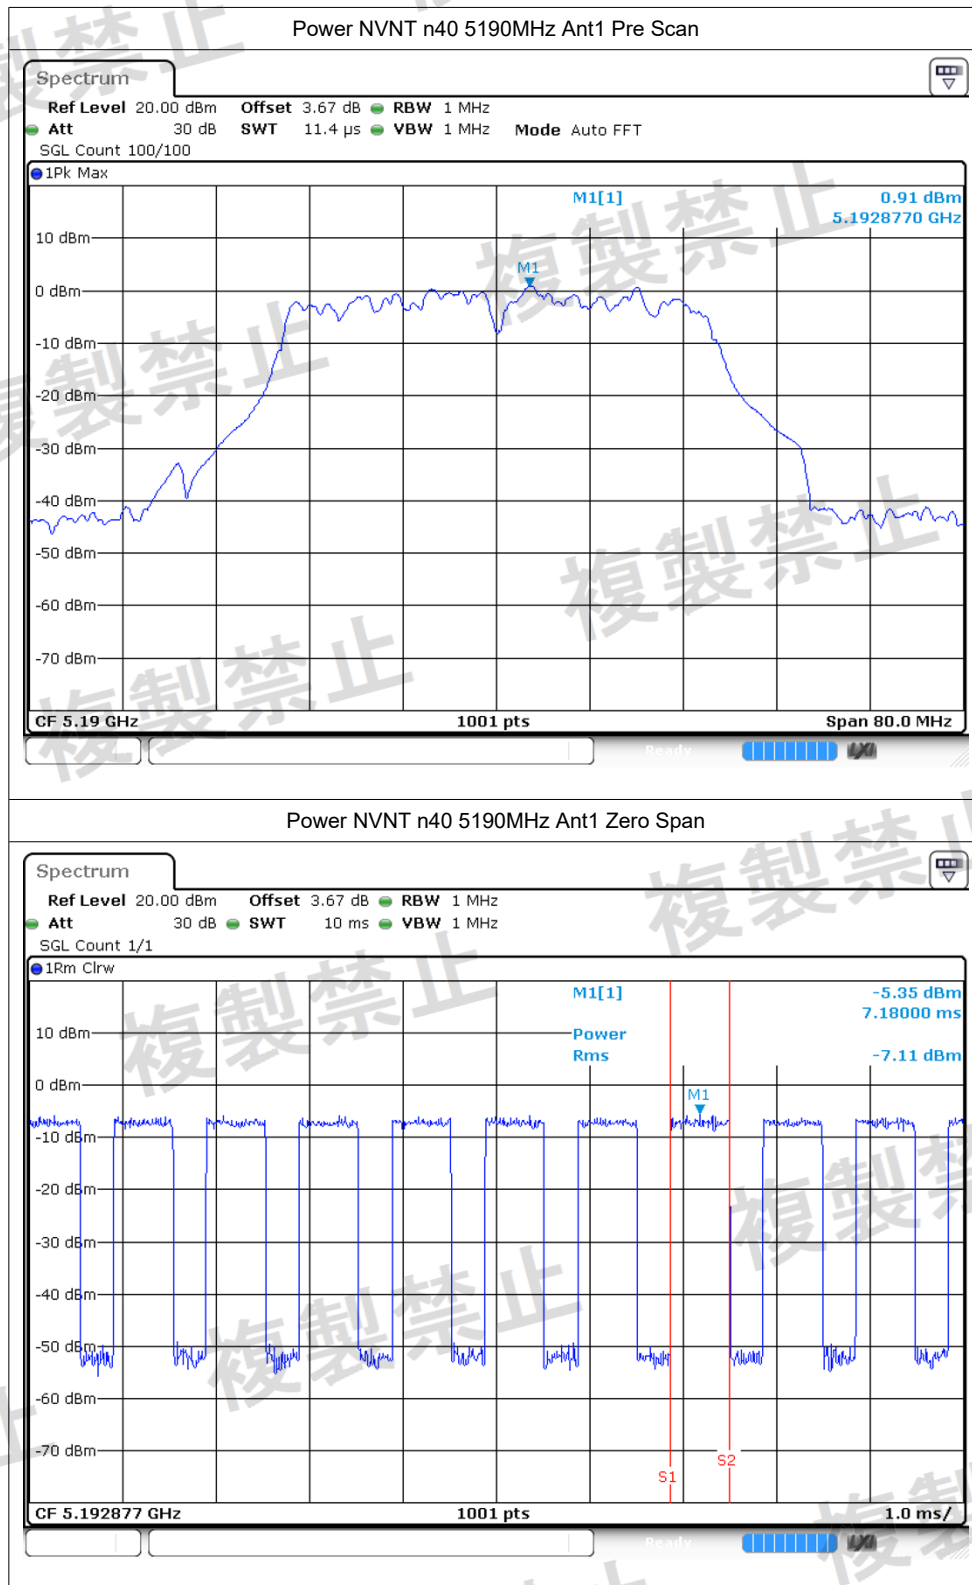


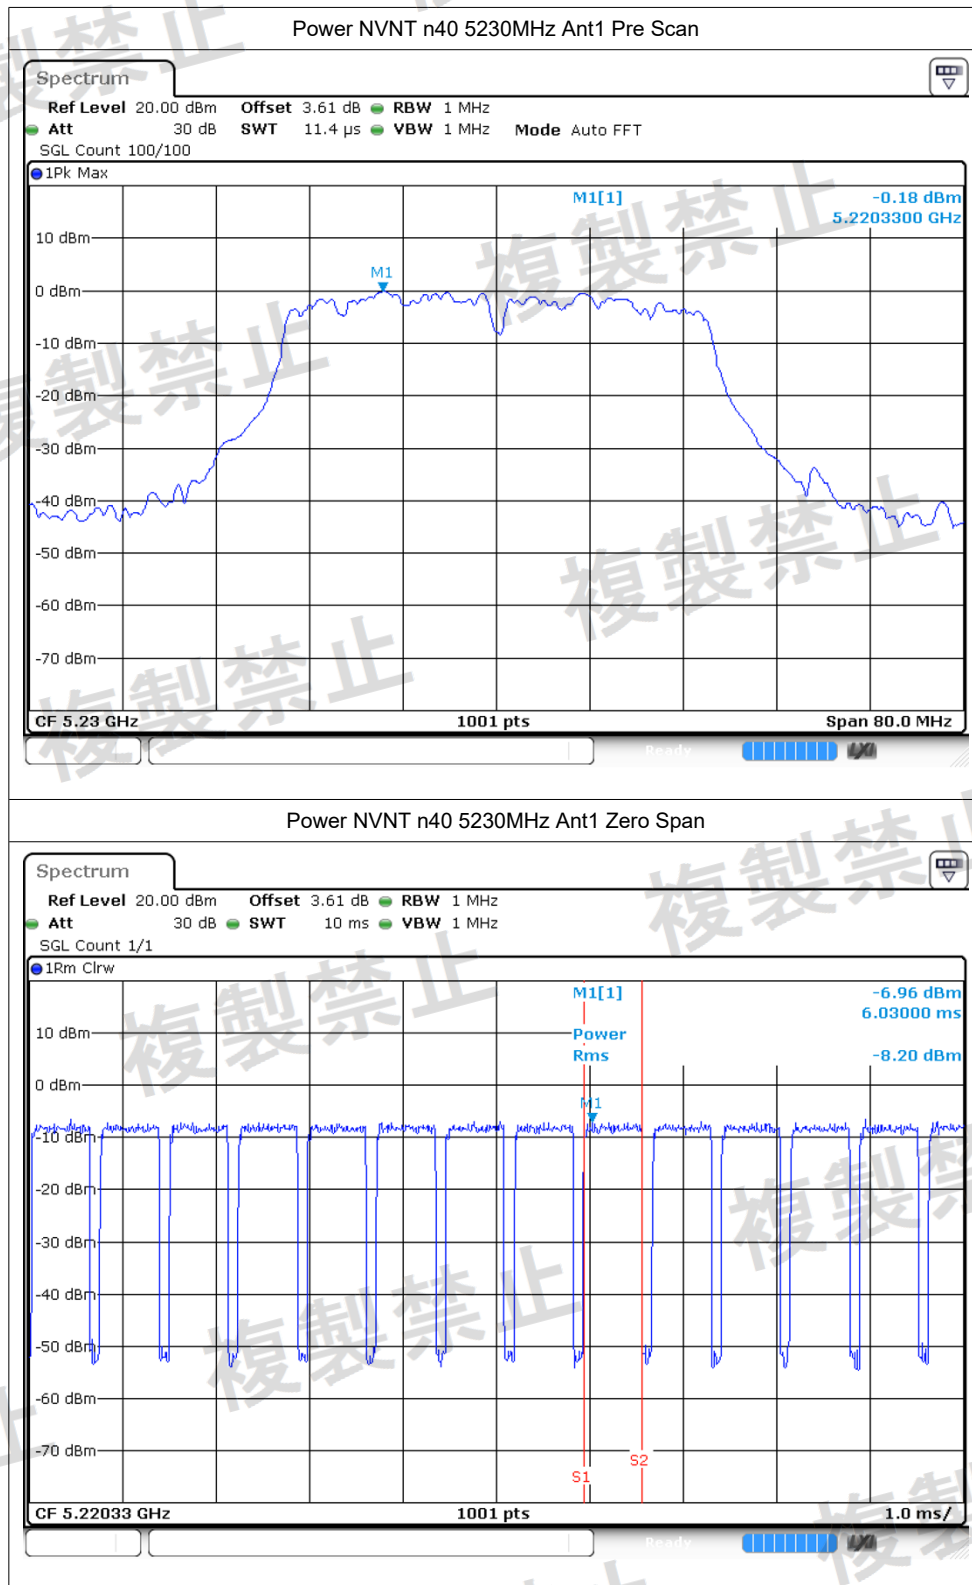


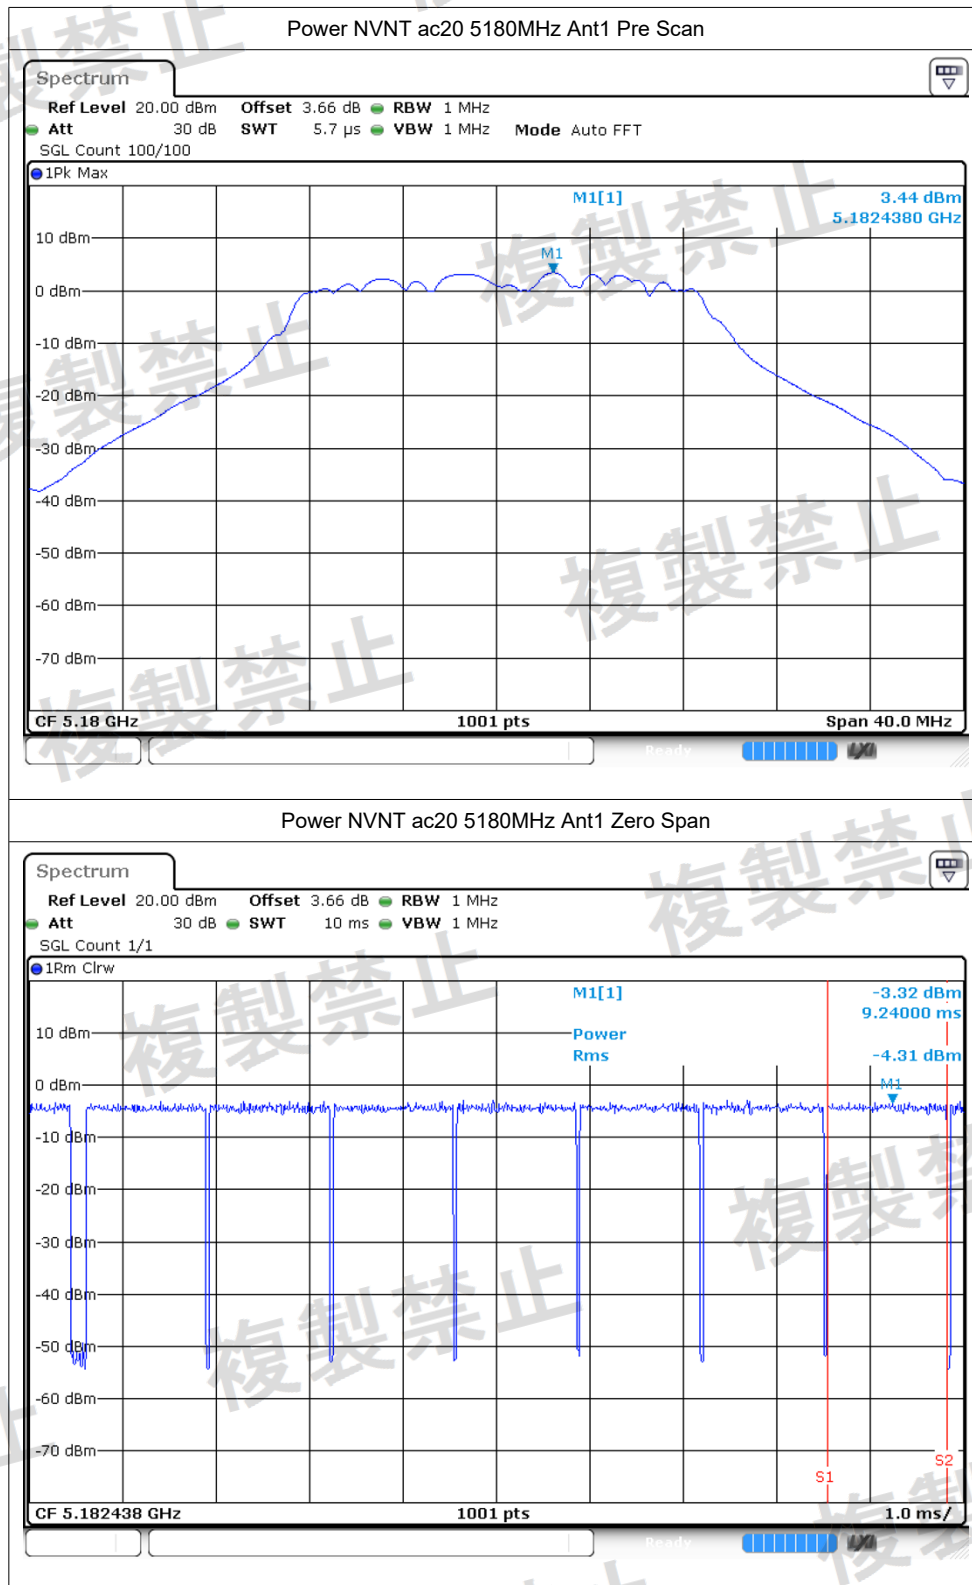


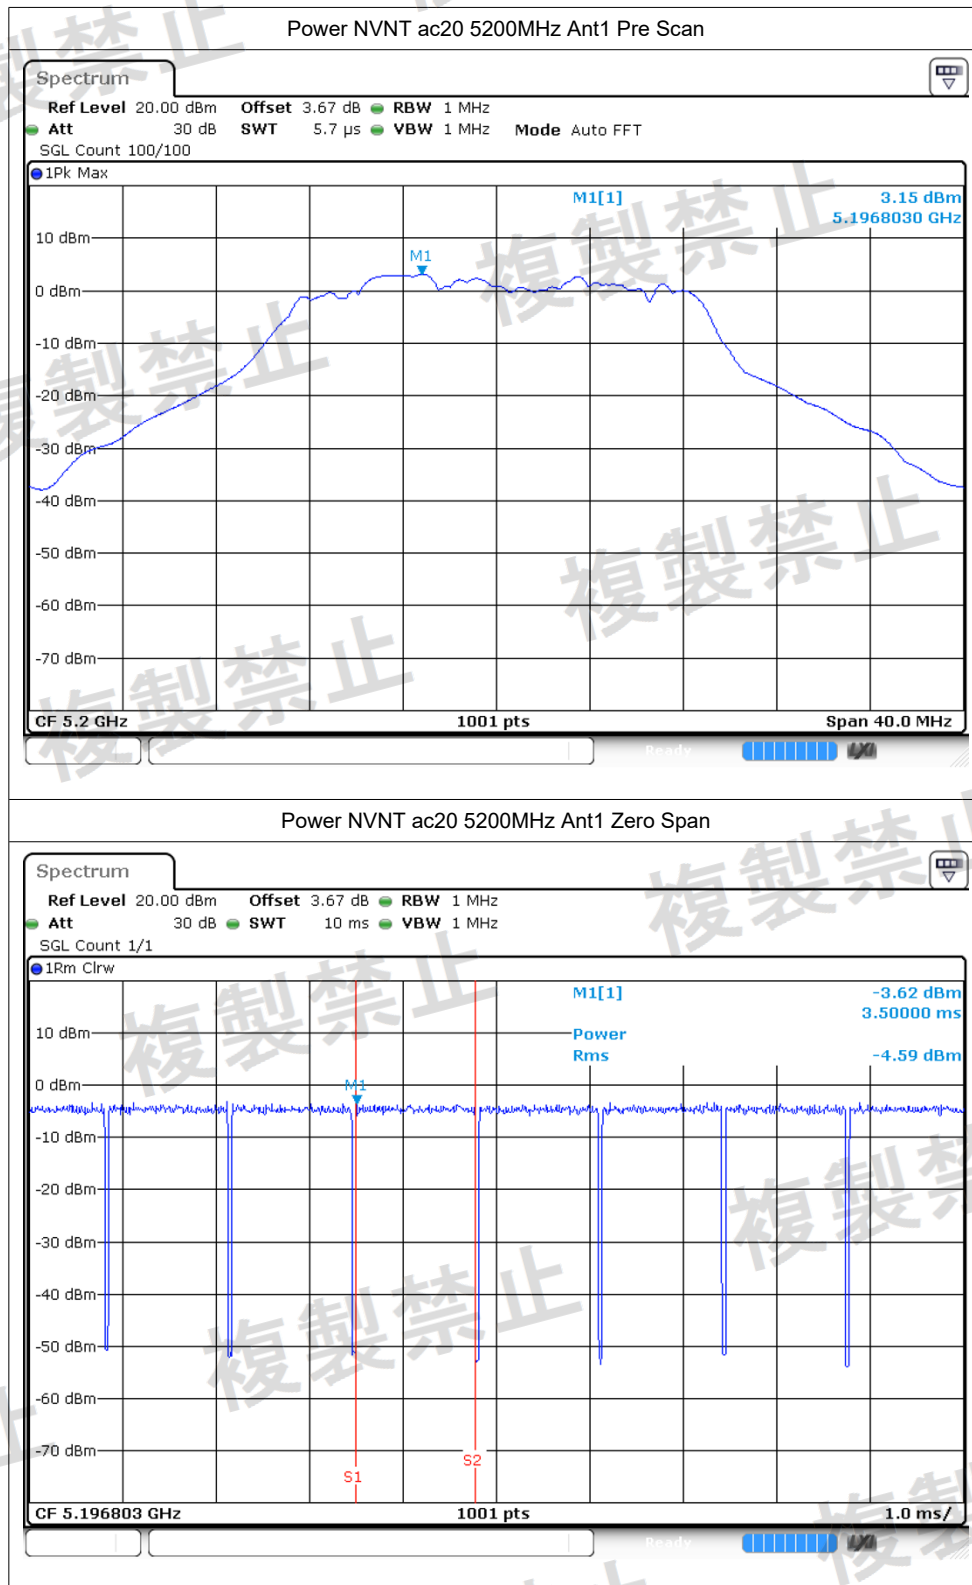


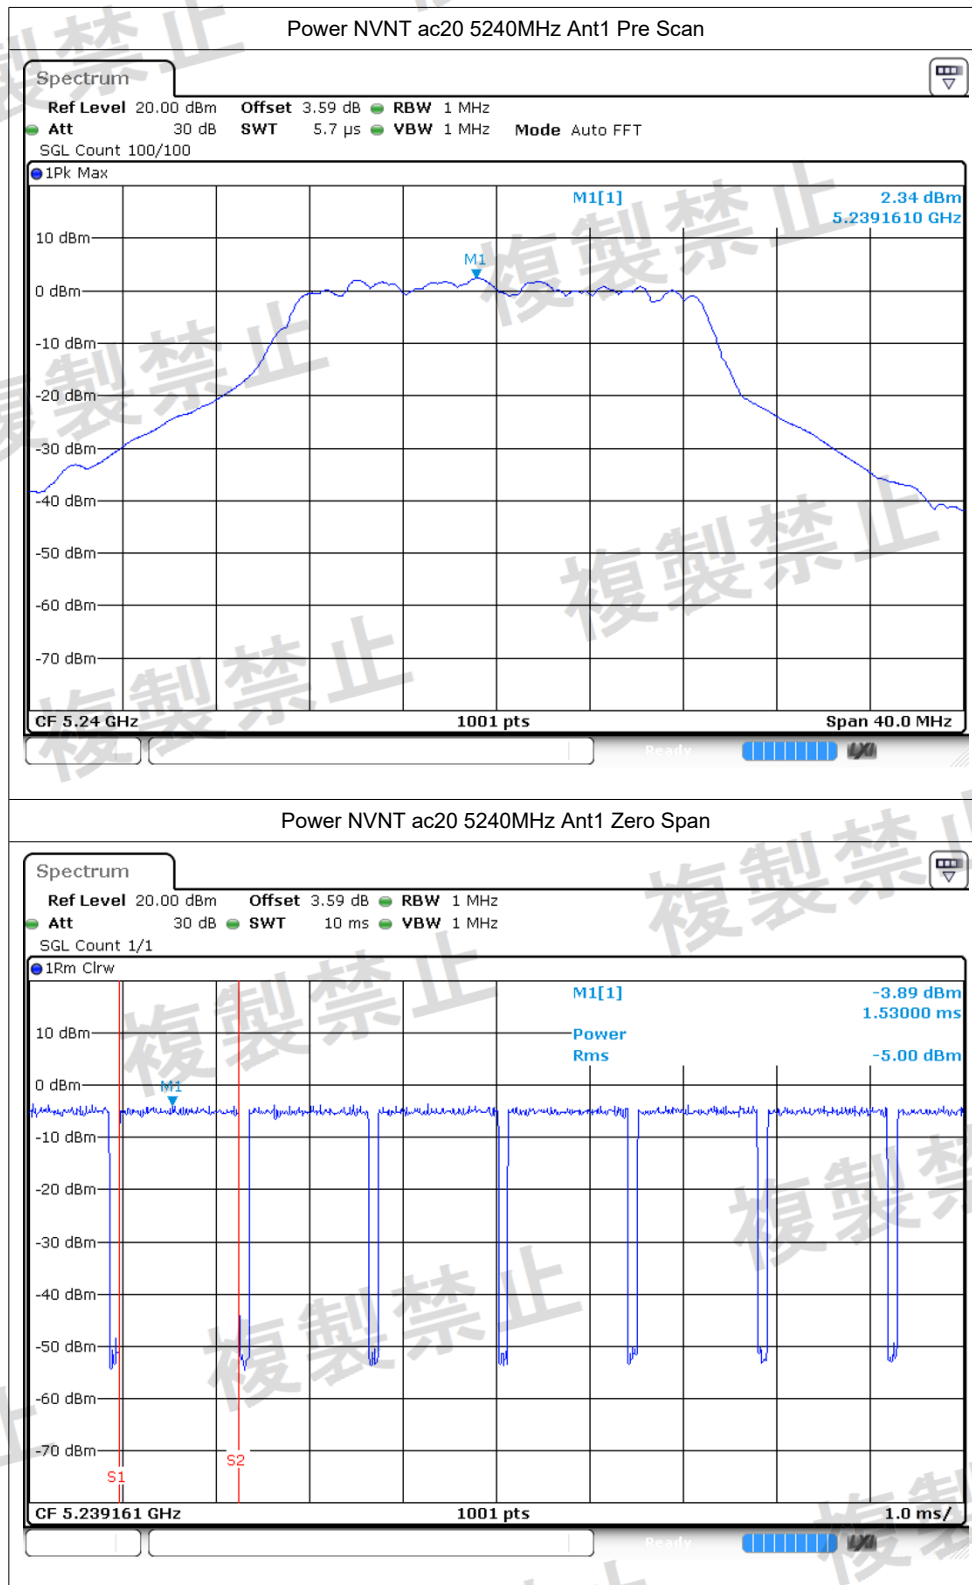


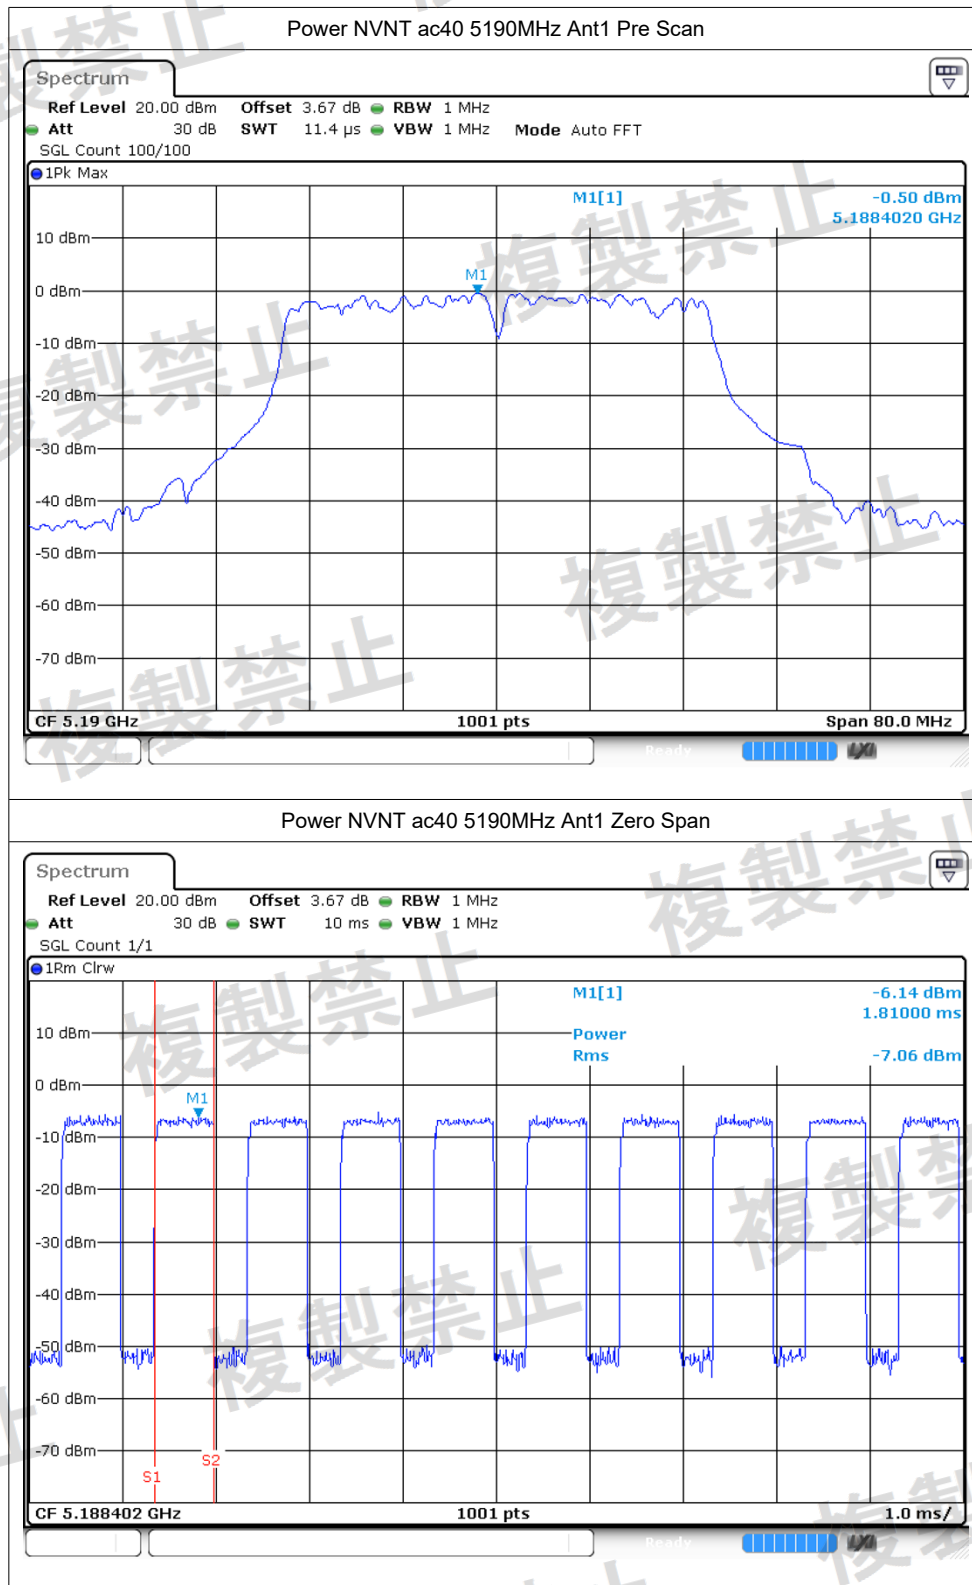


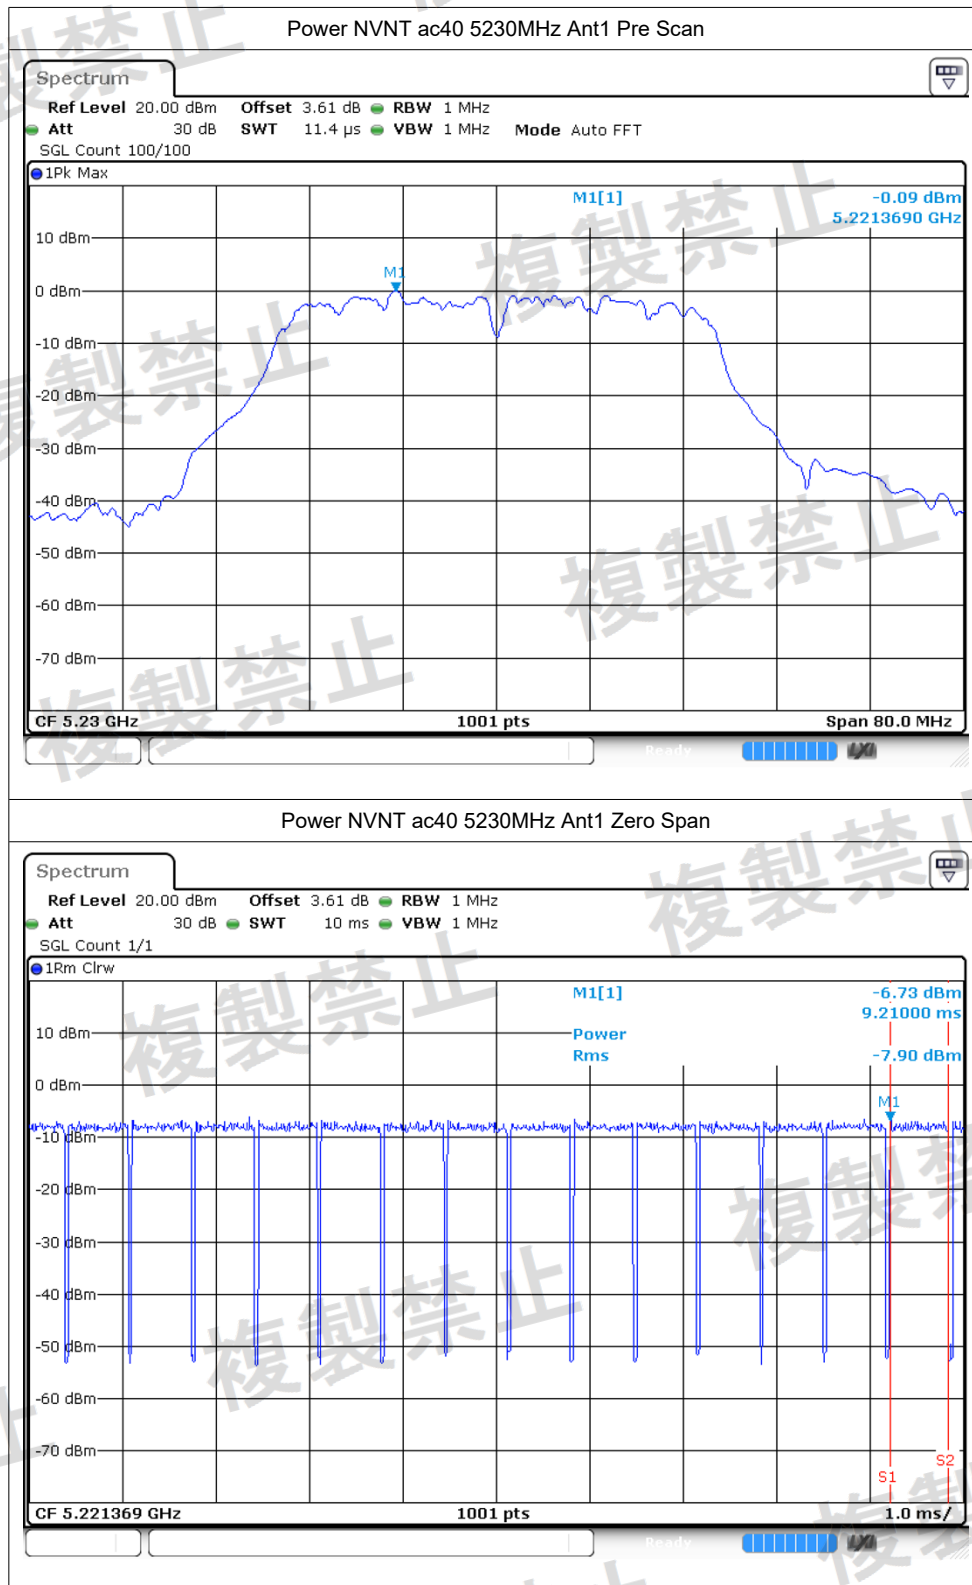


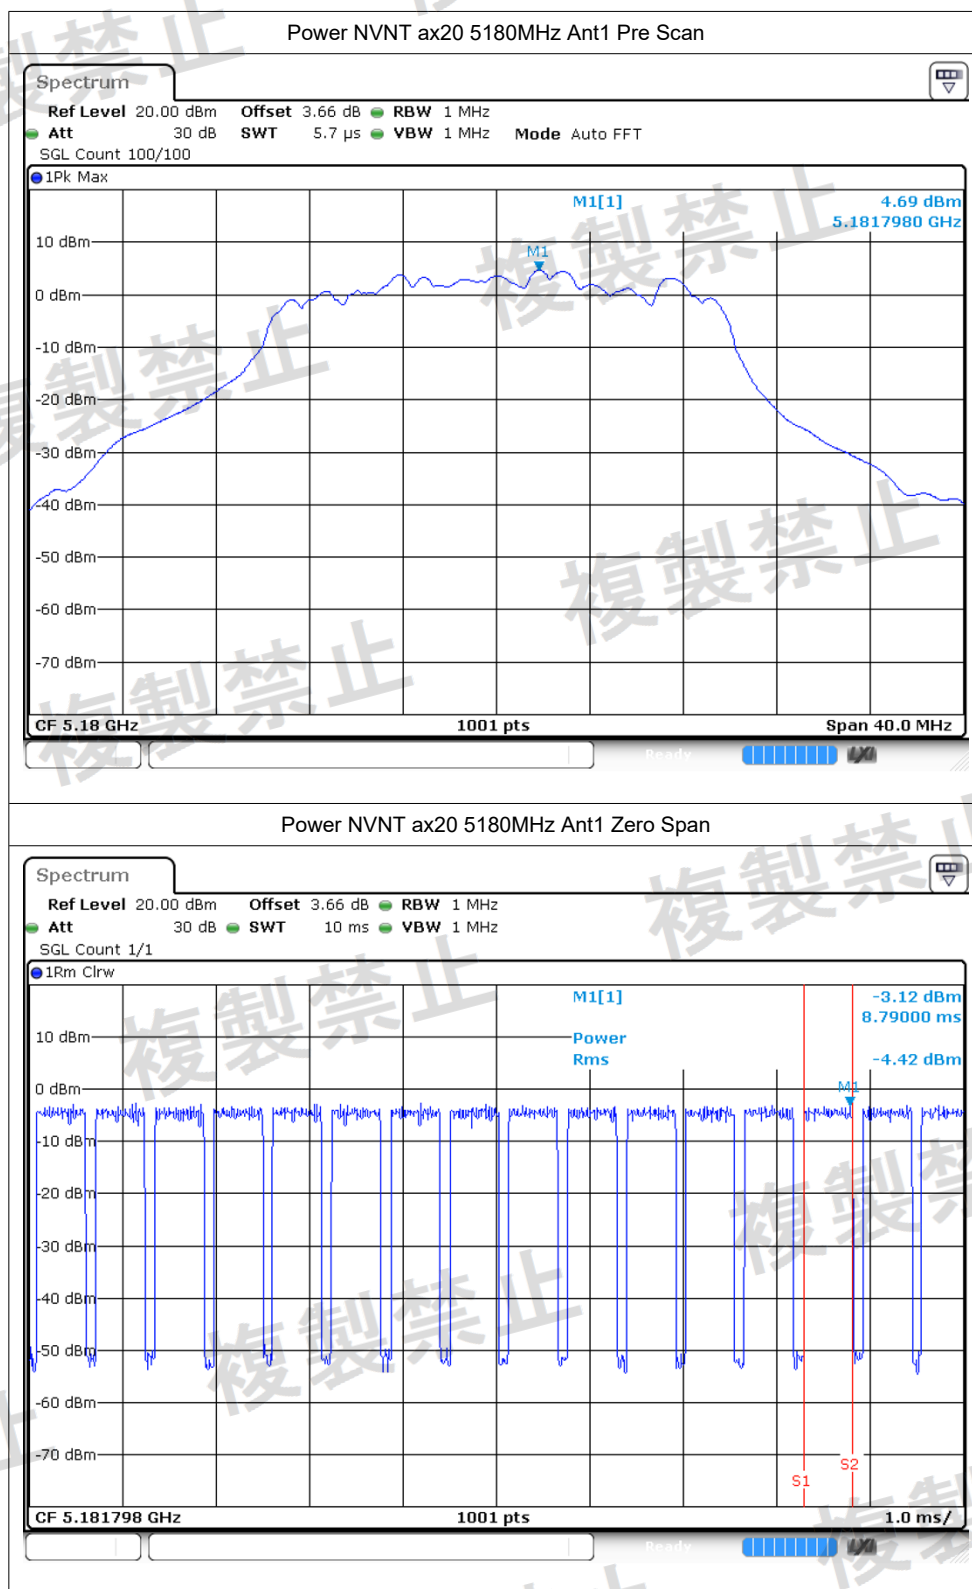

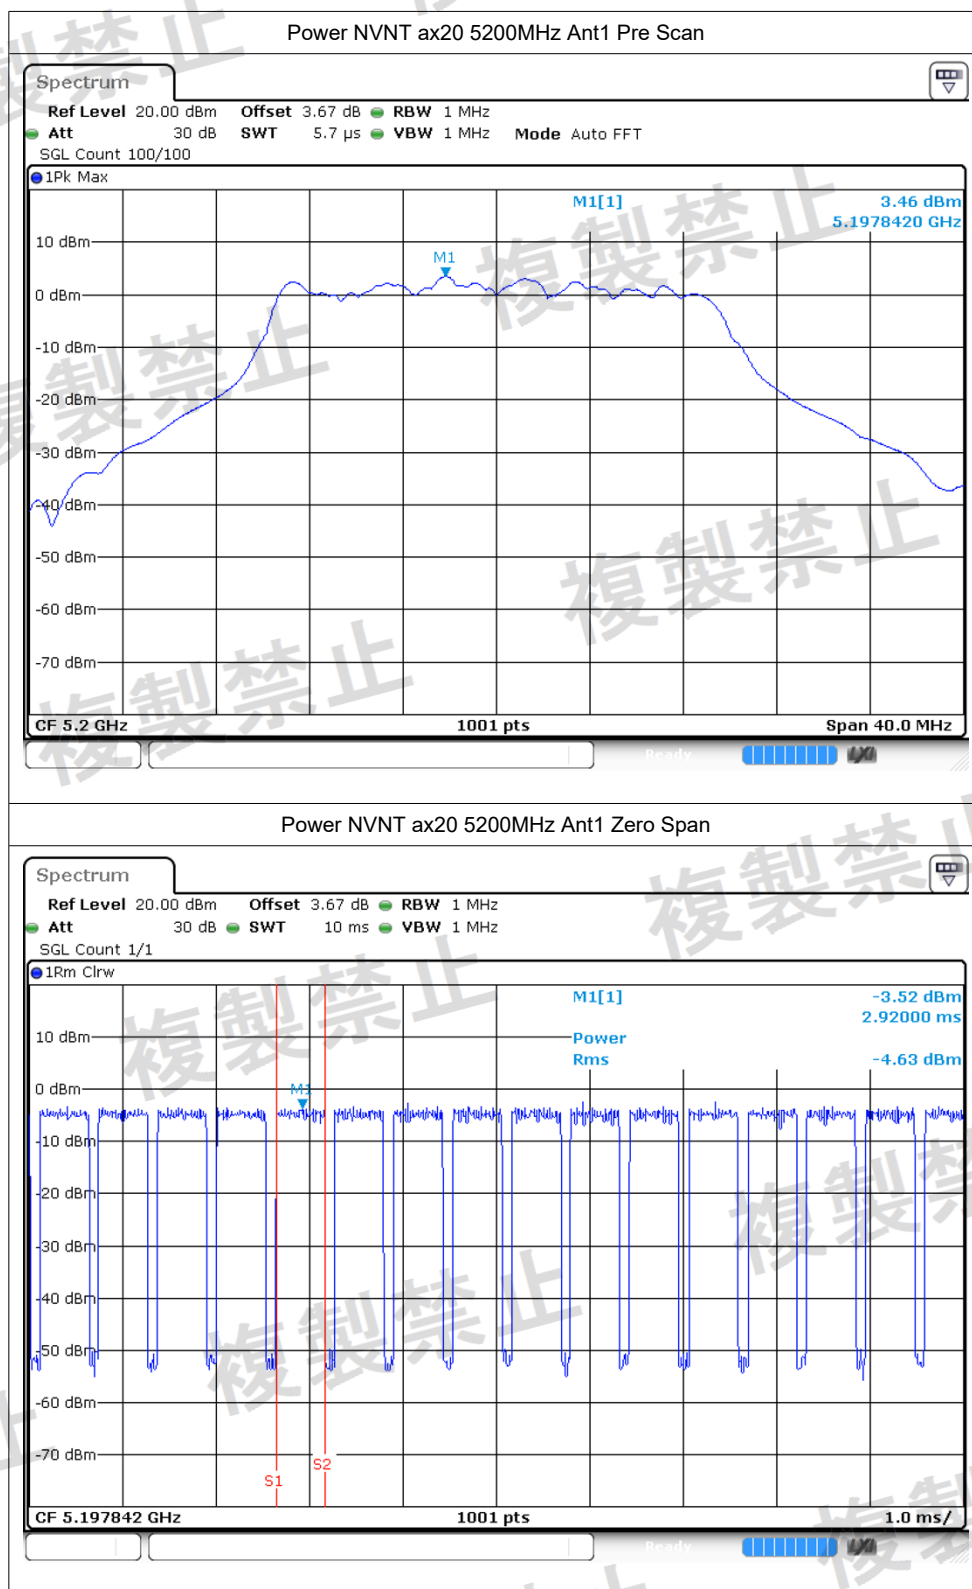

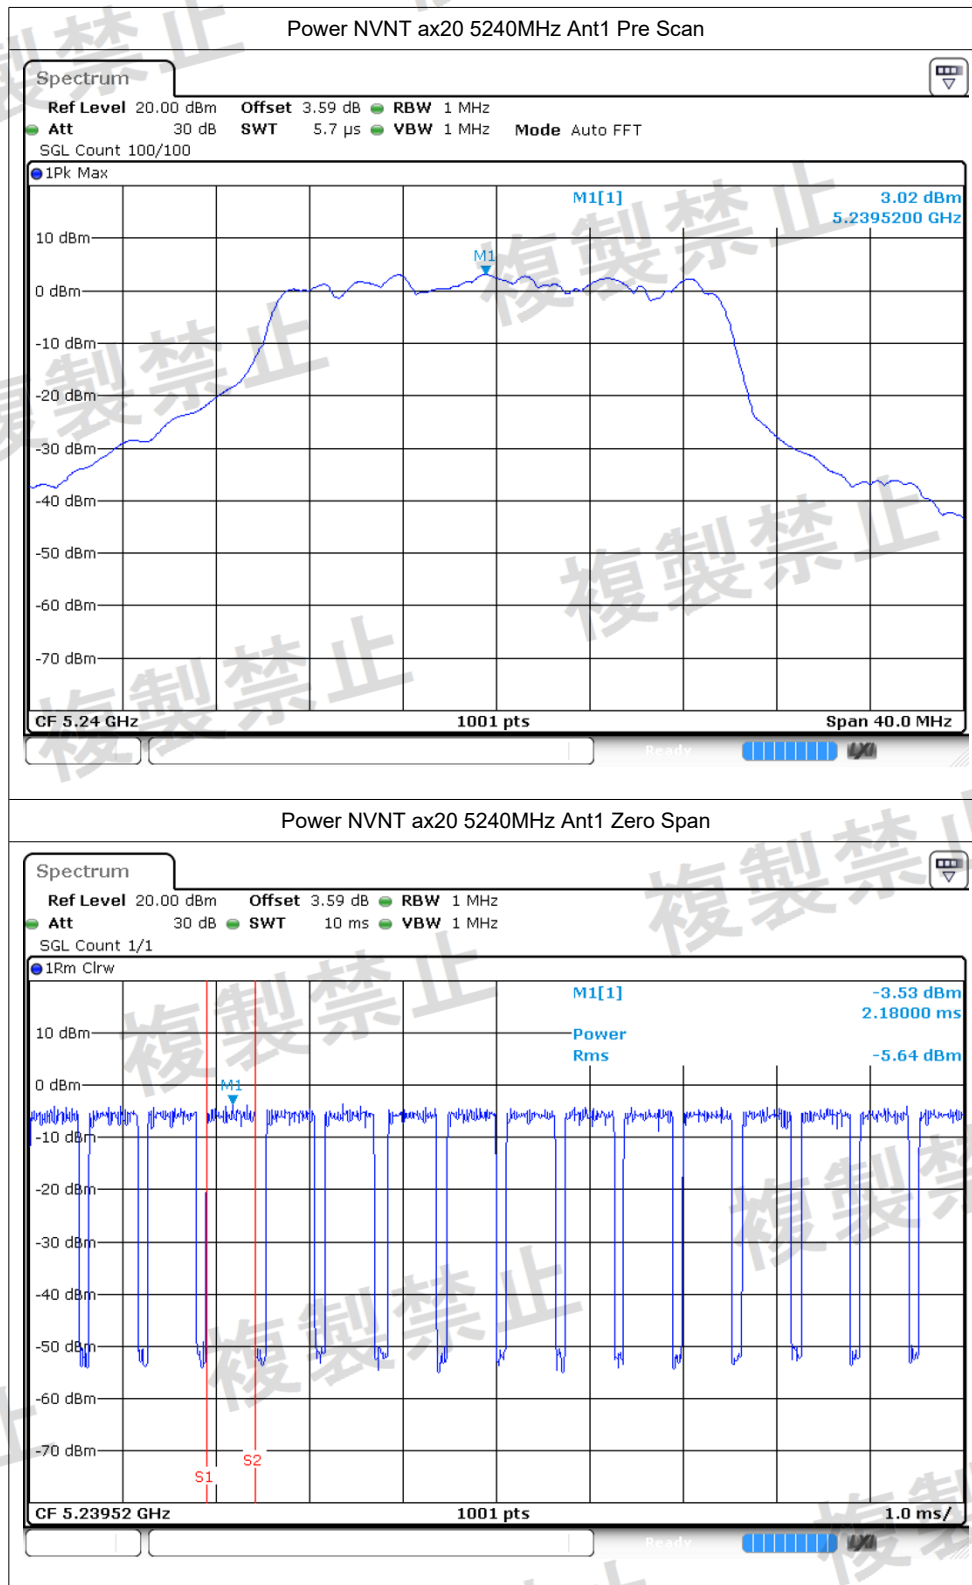

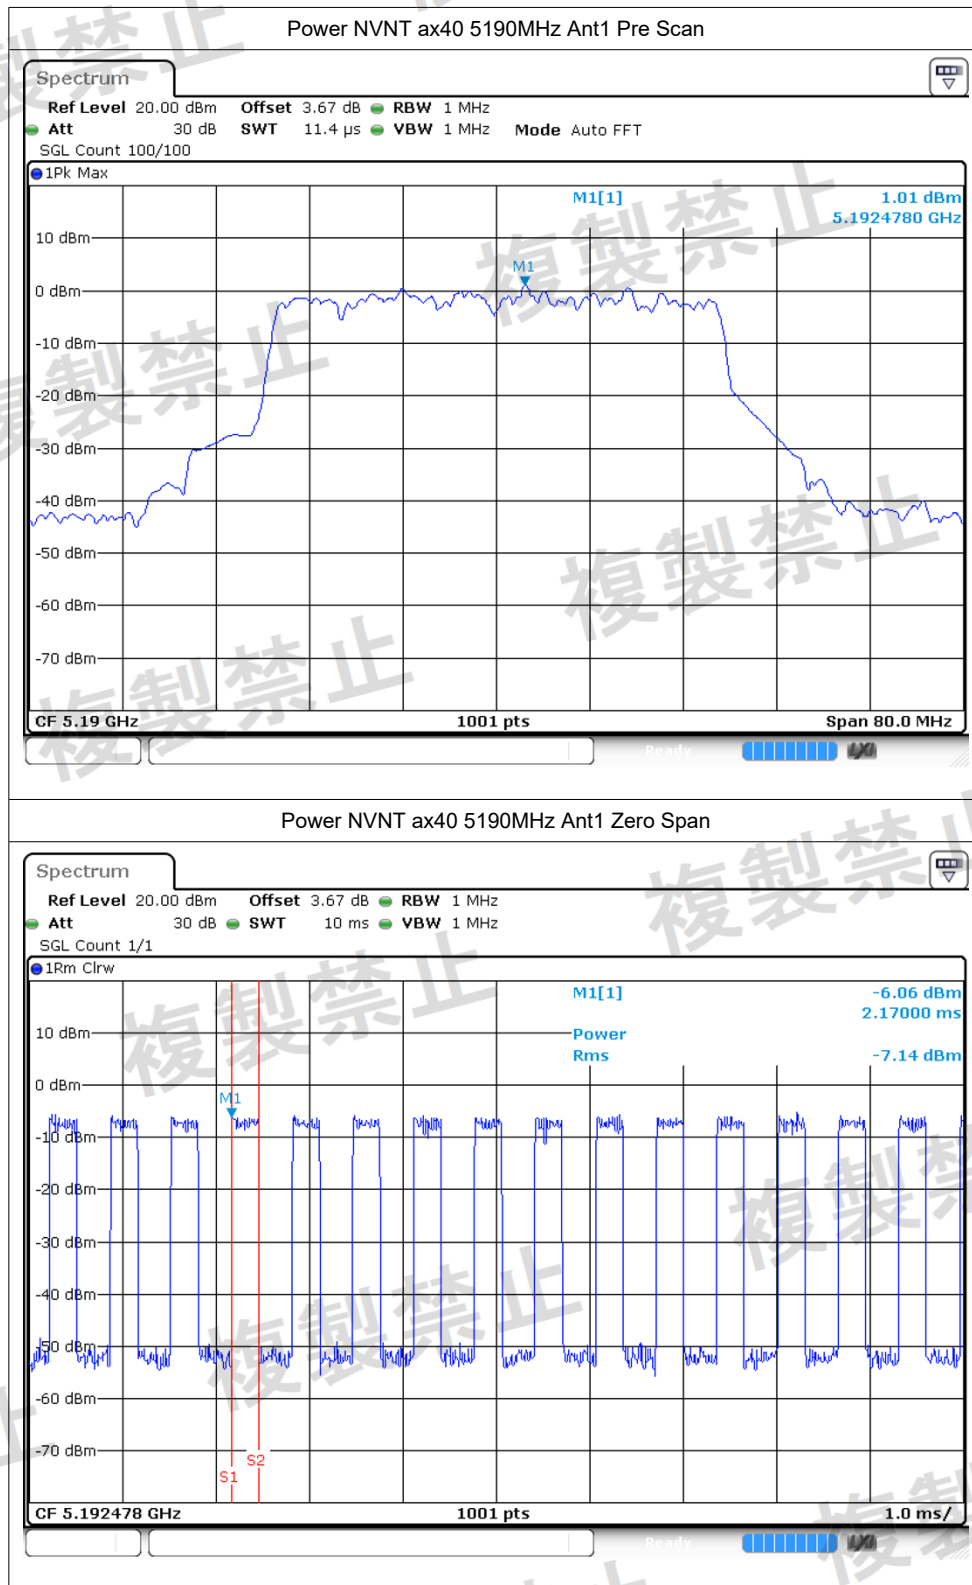

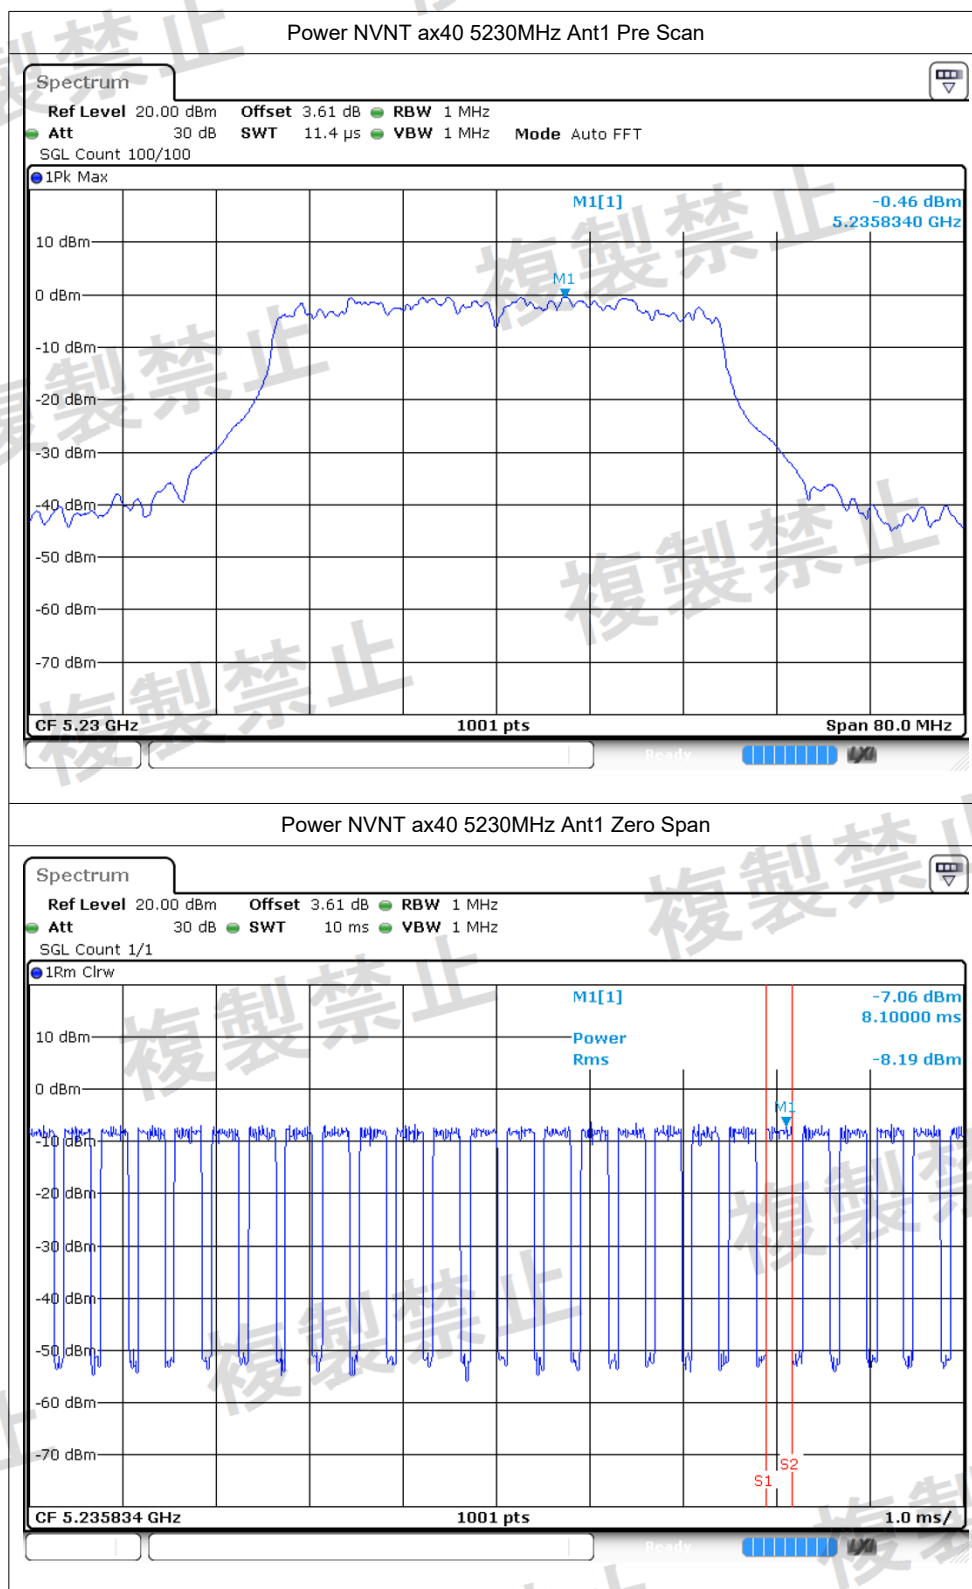




EIRP Power



Condition	Mode	Frequency (MHz)	Antenna	Power (dBm/MHz)	Power (mW/MHz)	Gain (dBi)	EIRP (dBm/MHz)	EIRP (mW/MHz)	Limit (mW/MHz)	Verdict
NVNT	a	5180	Ant1	-3.16	0.483	-3.2	-6.36	0.231	10	Pass
NVNT	a	5200	Ant1	-3.95	0.403	-3.2	-7.15	0.193	10	Pass
NVNT	a	5240	Ant1	-4.13	0.386	-3.2	-7.33	0.185	10	Pass
NVNT	n20	5180	Ant1	-4.67	0.341	-3.2	-7.87	0.163	10	Pass
NVNT	n20	5200	Ant1	-4.38	0.365	-3.2	-7.58	0.175	10	Pass
NVNT	n20	5240	Ant1	-5.85	0.26	-3.2	-9.05	0.124	10	Pass
NVNT	n40	5190	Ant1	-7.11	0.195	-3.2	-10.31	0.093	5	Pass
NVNT	n40	5230	Ant1	-8.2	0.151	-3.2	-11.4	0.072	5	Pass
NVNT	ac20	5180	Ant1	-4.31	0.371	-3.2	-7.51	0.177	10	Pass
NVNT	ac20	5200	Ant1	-4.59	0.348	-3.2	-7.79	0.166	10	Pass
NVNT	ac20	5240	Ant1	-5	0.316	-3.2	-8.2	0.151	10	Pass
NVNT	ac40	5190	Ant1	-7.06	0.197	-3.2	-10.26	0.094	5	Pass
NVNT	ac40	5230	Ant1	-7.9	0.162	-3.2	-11.1	0.078	5	Pass
NVNT	ax20	5180	Ant1	-4.42	0.361	-3.2	-7.62	0.173	10	Pass
NVNT	ax20	5200	Ant1	-4.63	0.344	-3.2	-7.83	0.165	10	Pass
NVNT	ax20	5240	Ant1	-5.64	0.273	-3.2	-8.84	0.131	10	Pass
NVNT	ax40	5190	Ant1	-7.14	0.193	-3.2	-10.34	0.092	5	Pass
NVNT	ax40	5230	Ant1	-8.19	0.152	-3.2	-11.39	0.073	5	Pass



Occupied Channel Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	99% OBW (MHz)	Limit (MHz)	Verdict
NVNT	a	5180	Ant1	17.143	20	Pass
NVNT	a	5200	Ant1	17.183	20	Pass
NVNT	a	5240	Ant1	17.223	20	Pass
NVNT	n20	5180	Ant1	18.262	20	Pass
NVNT	n20	5200	Ant1	18.262	20	Pass
NVNT	n20	5240	Ant1	18.302	20	Pass
NVNT	n40	5190	Ant1	36.204	40	Pass
NVNT	n40	5230	Ant1	36.284	40	Pass
NVNT	ac20	5180	Ant1	18.262	20	Pass
NVNT	ac20	5200	Ant1	18.262	20	Pass
NVNT	ac20	5240	Ant1	18.302	20	Pass
NVNT	ac40	5190	Ant1	36.364	40	Pass
NVNT	ac40	5230	Ant1	36.284	40	Pass
NVNT	ax20	5180	Ant1	19.261	20	Pass
NVNT	ax20	5200	Ant1	19.301	20	Pass
NVNT	ax20	5240	Ant1	19.261	20	Pass
NVNT	ax40	5190	Ant1	37.882	40	Pass
NVNT	ax40	5230	Ant1	37.882	40	Pass

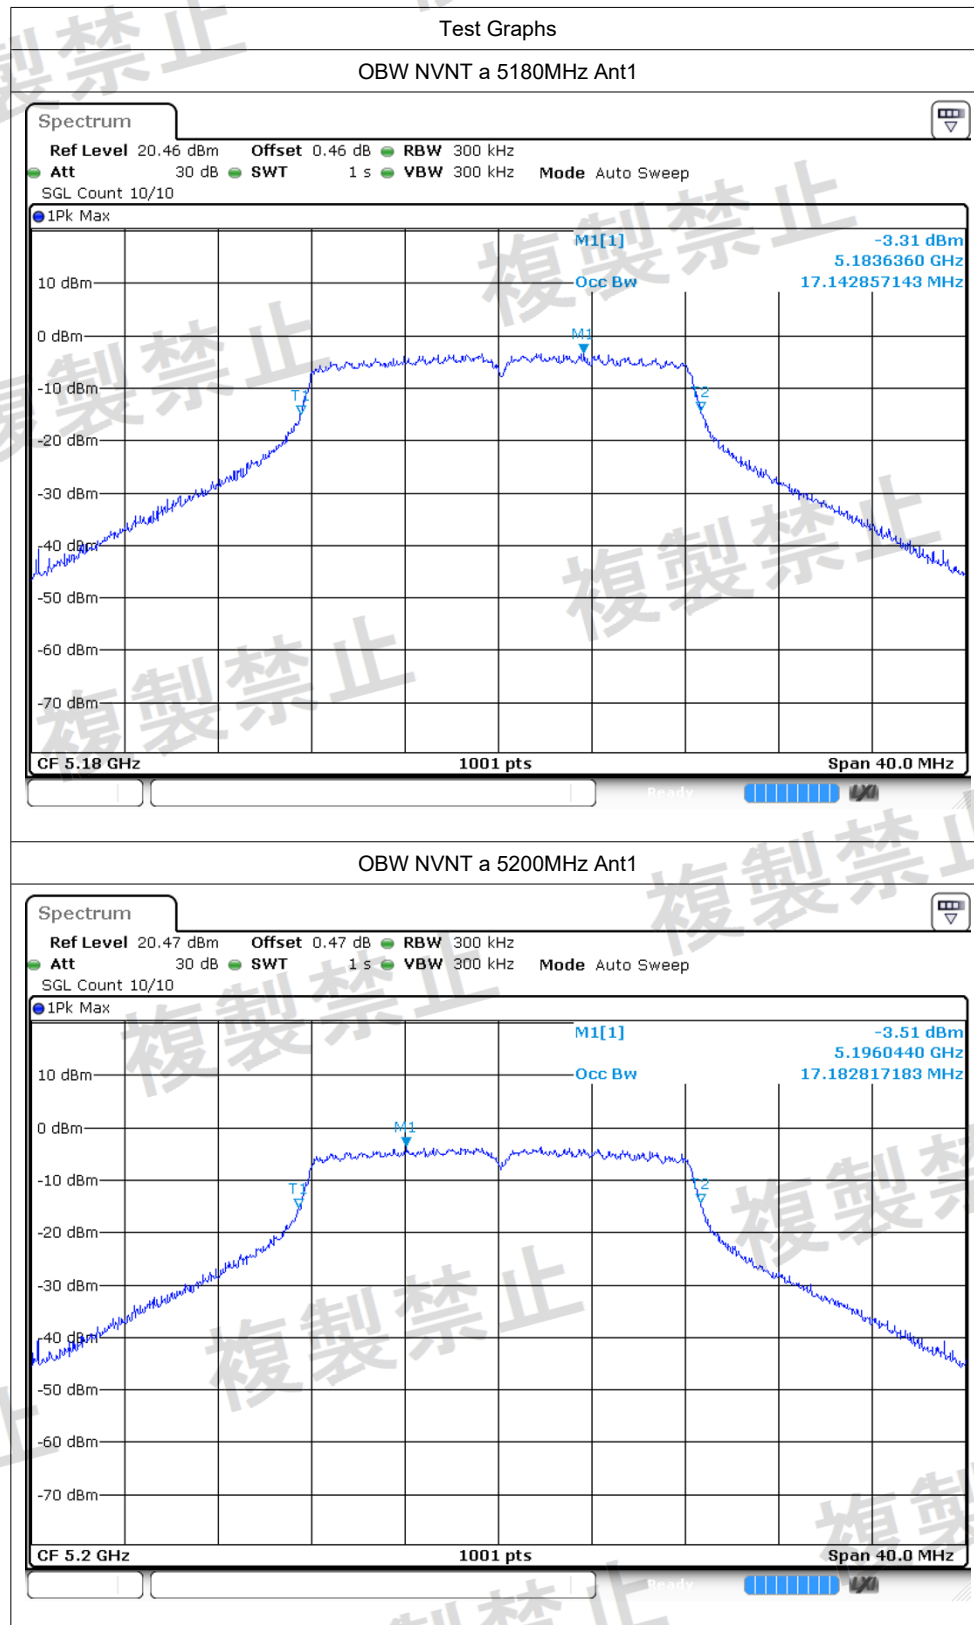


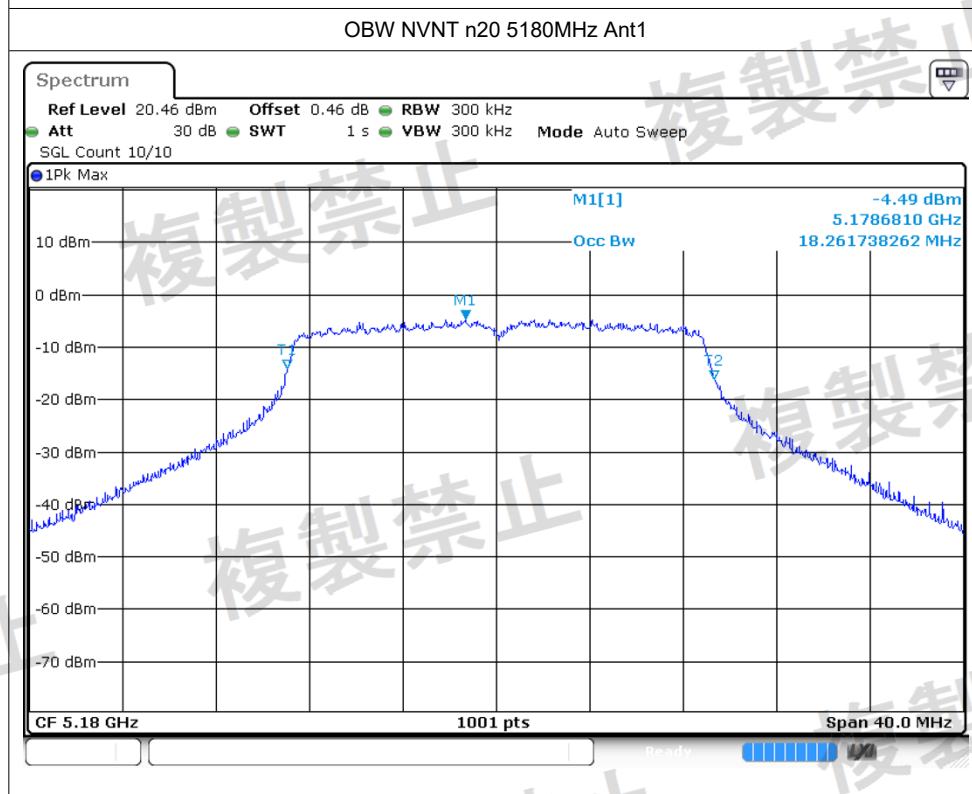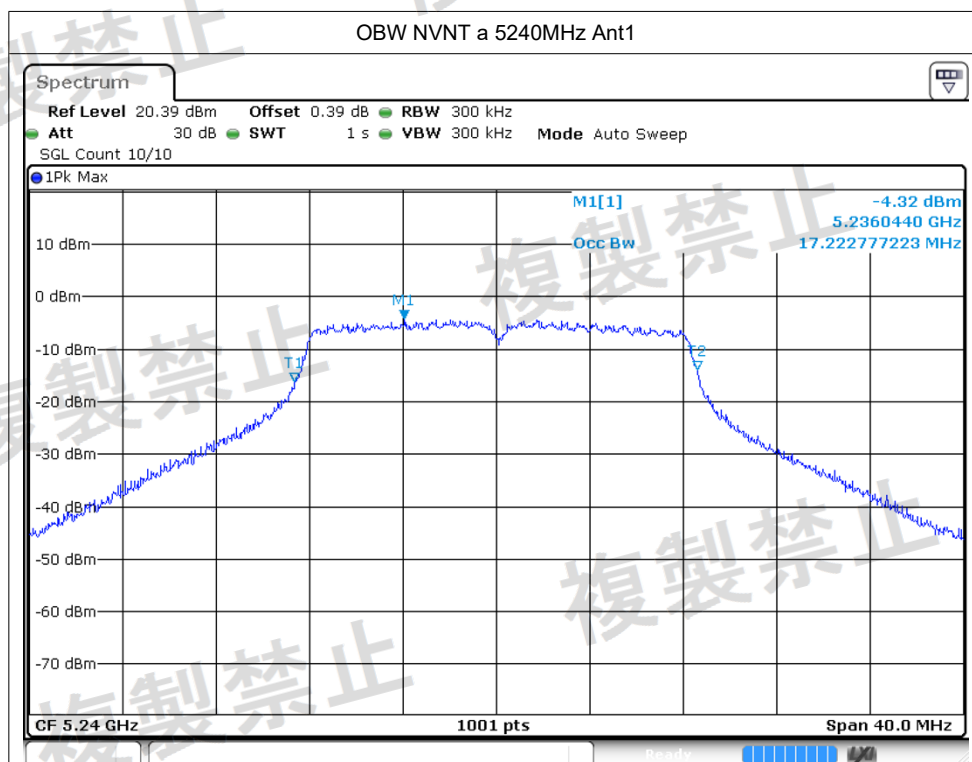


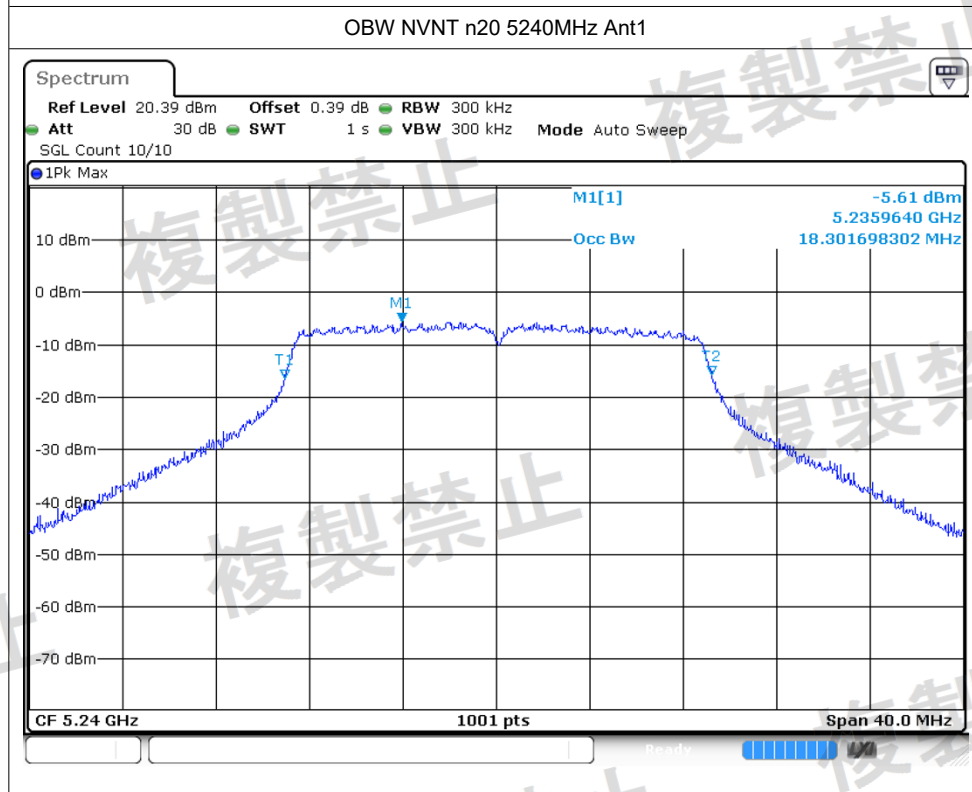
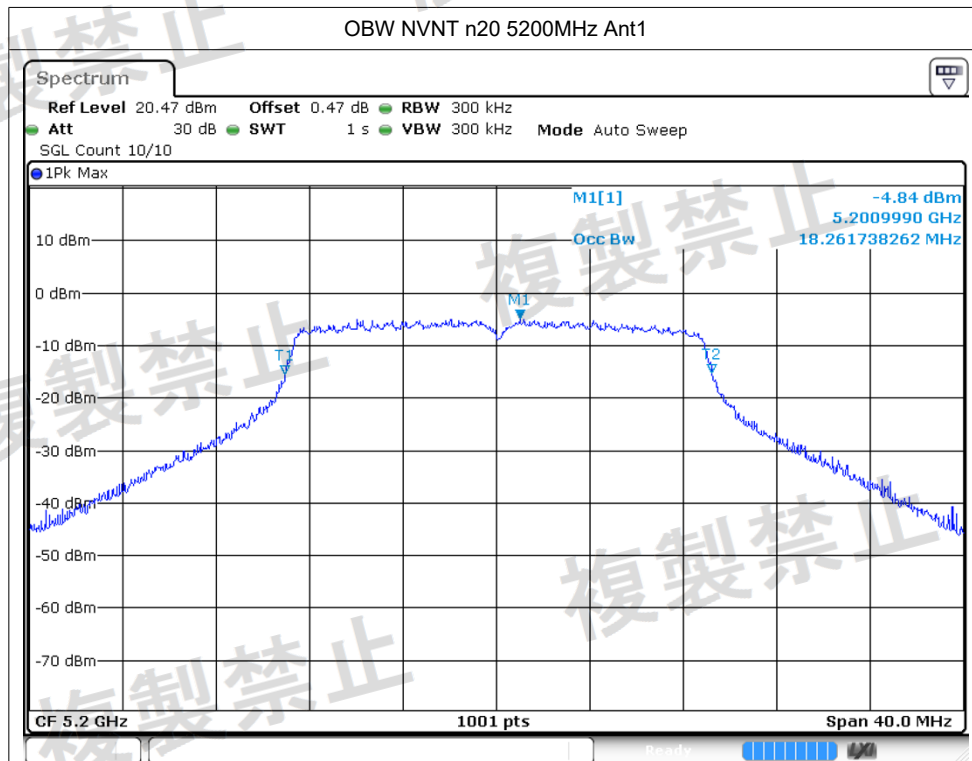


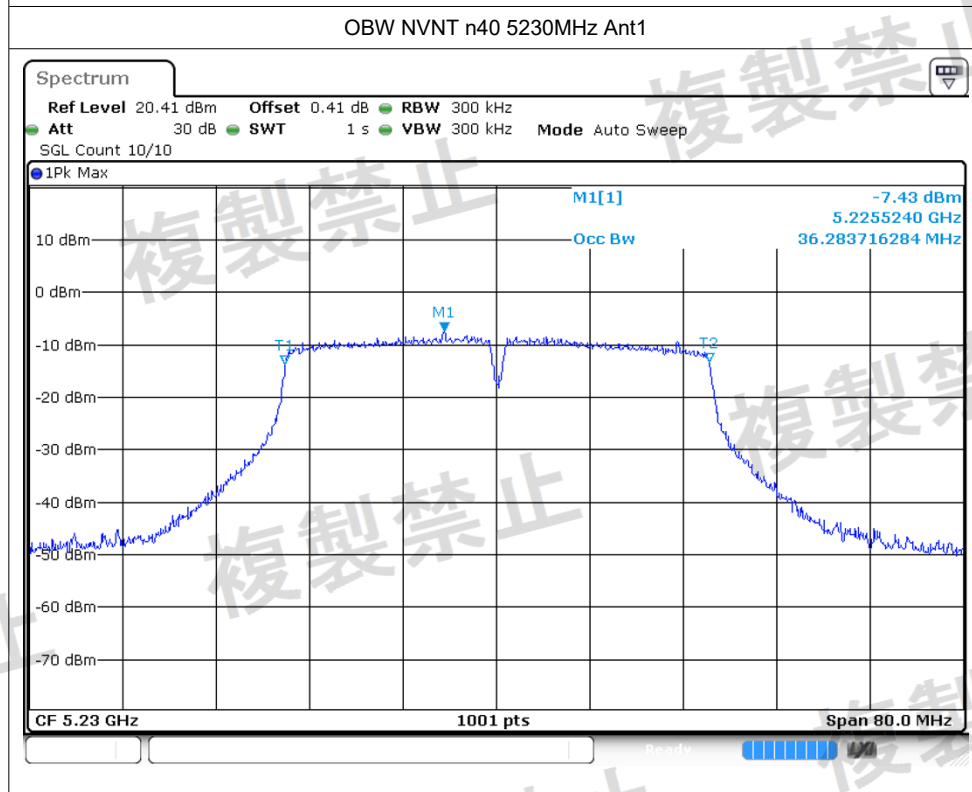
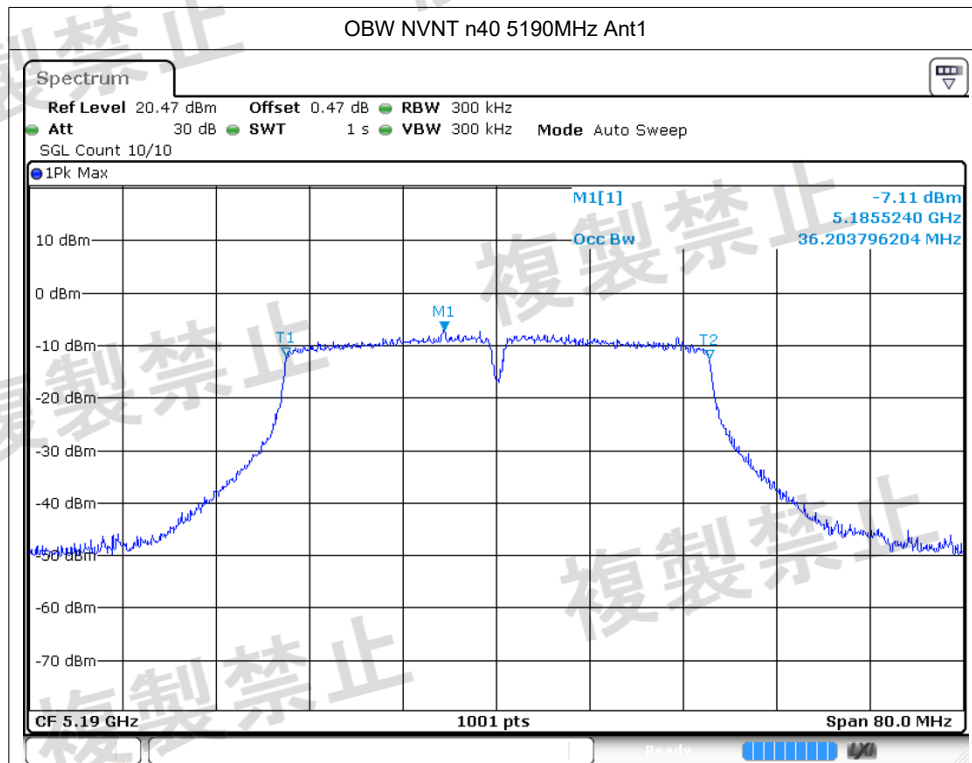


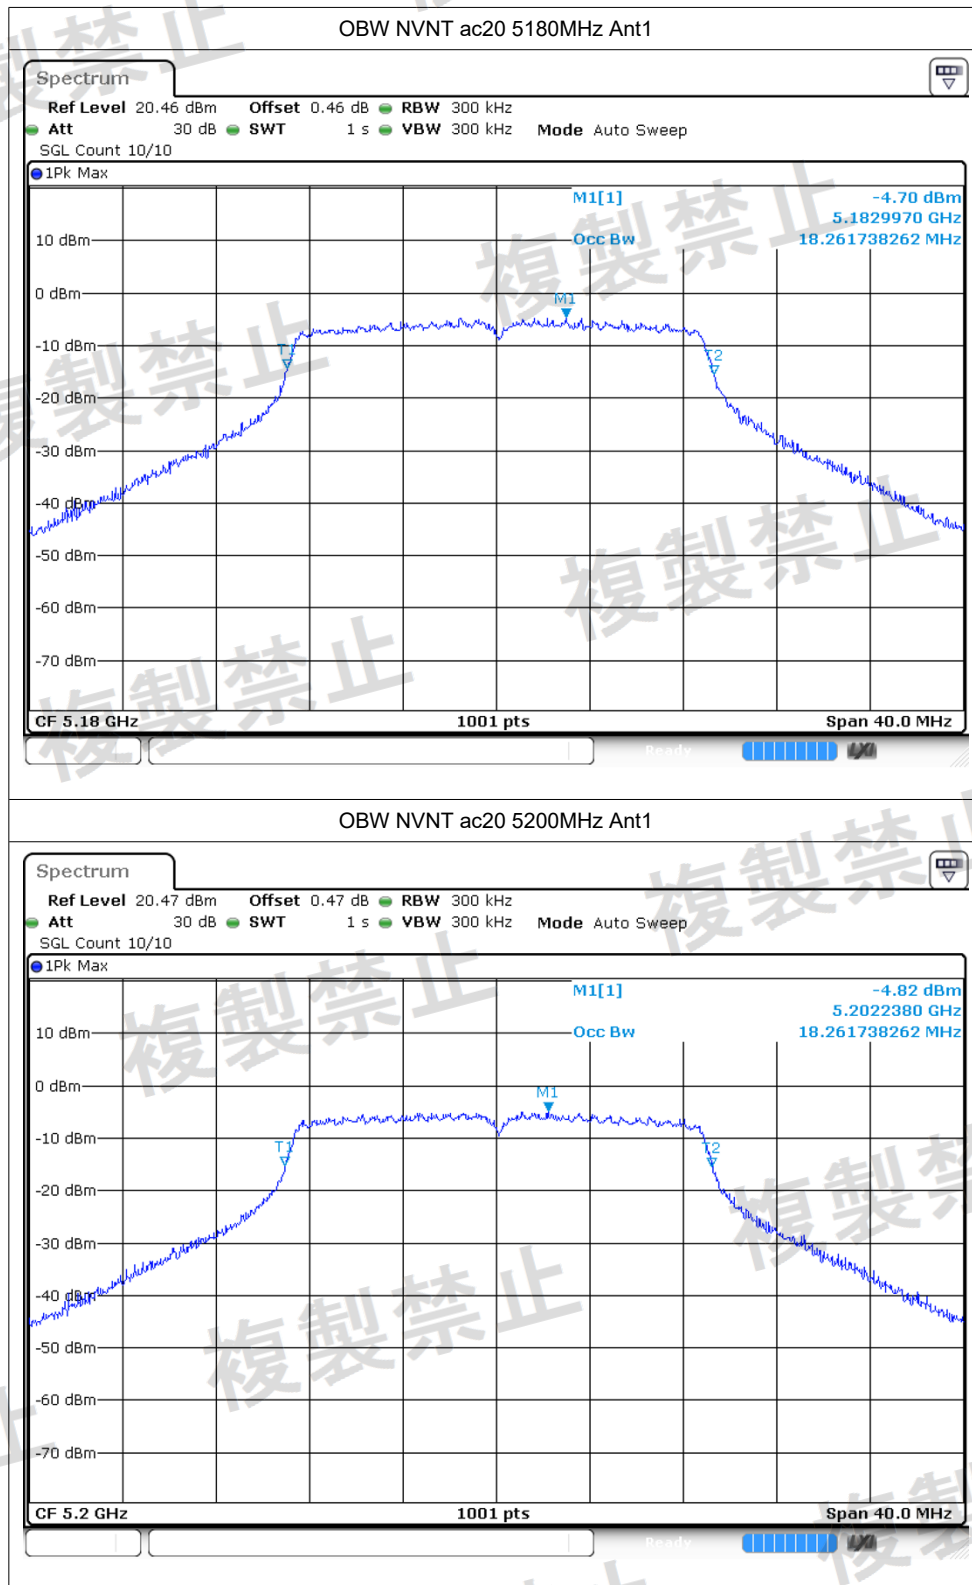

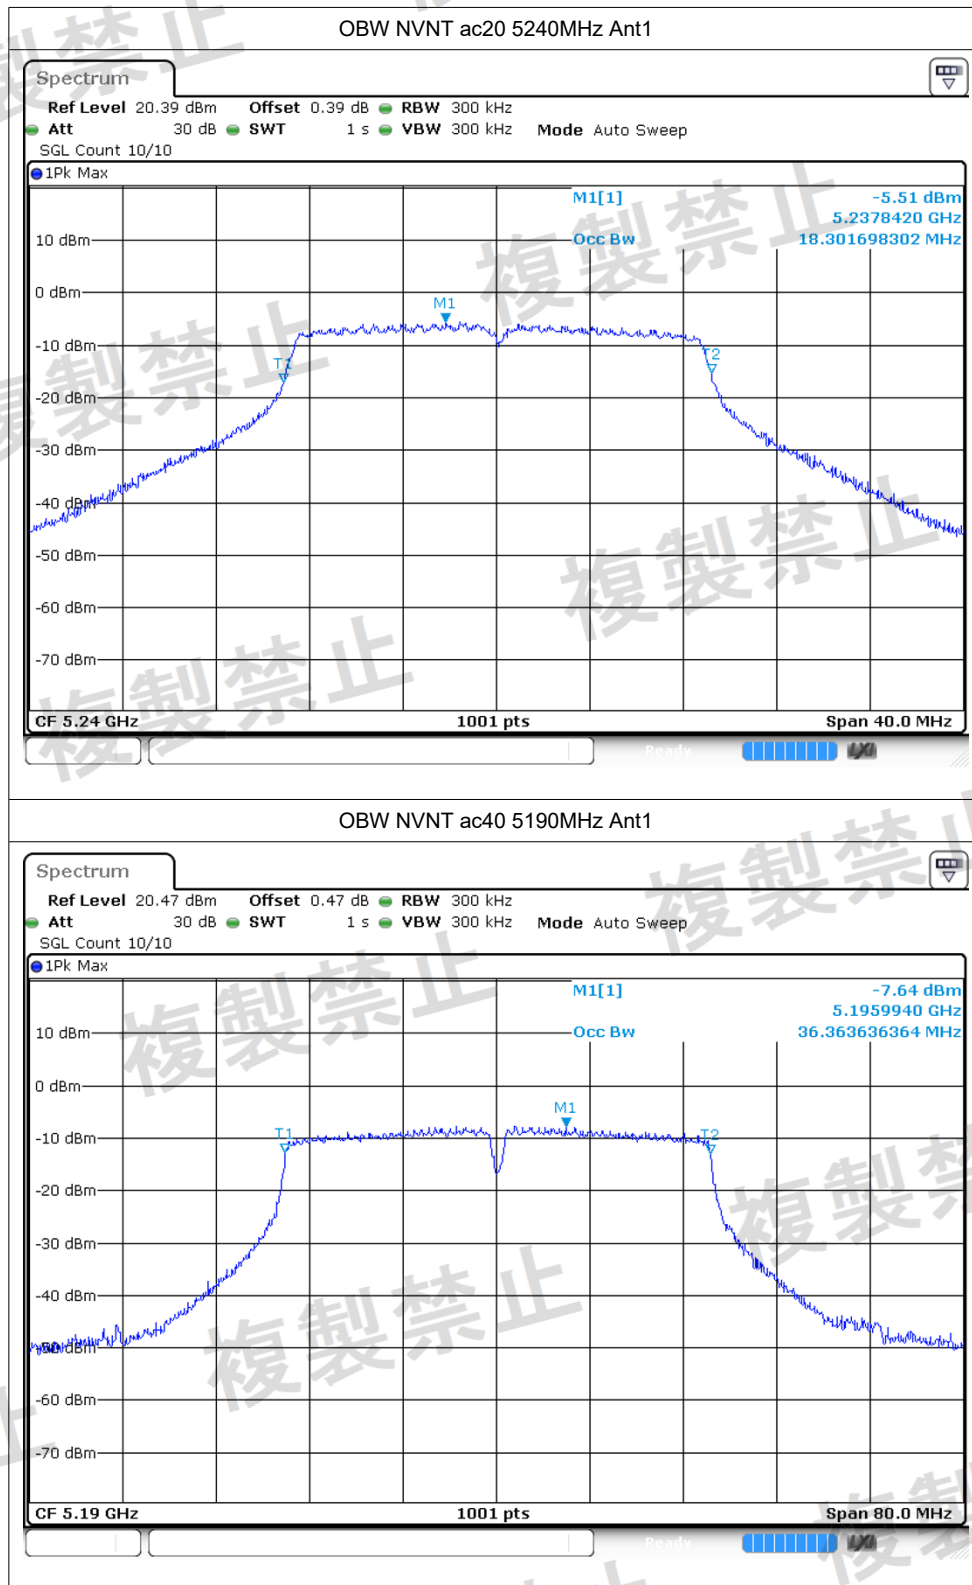

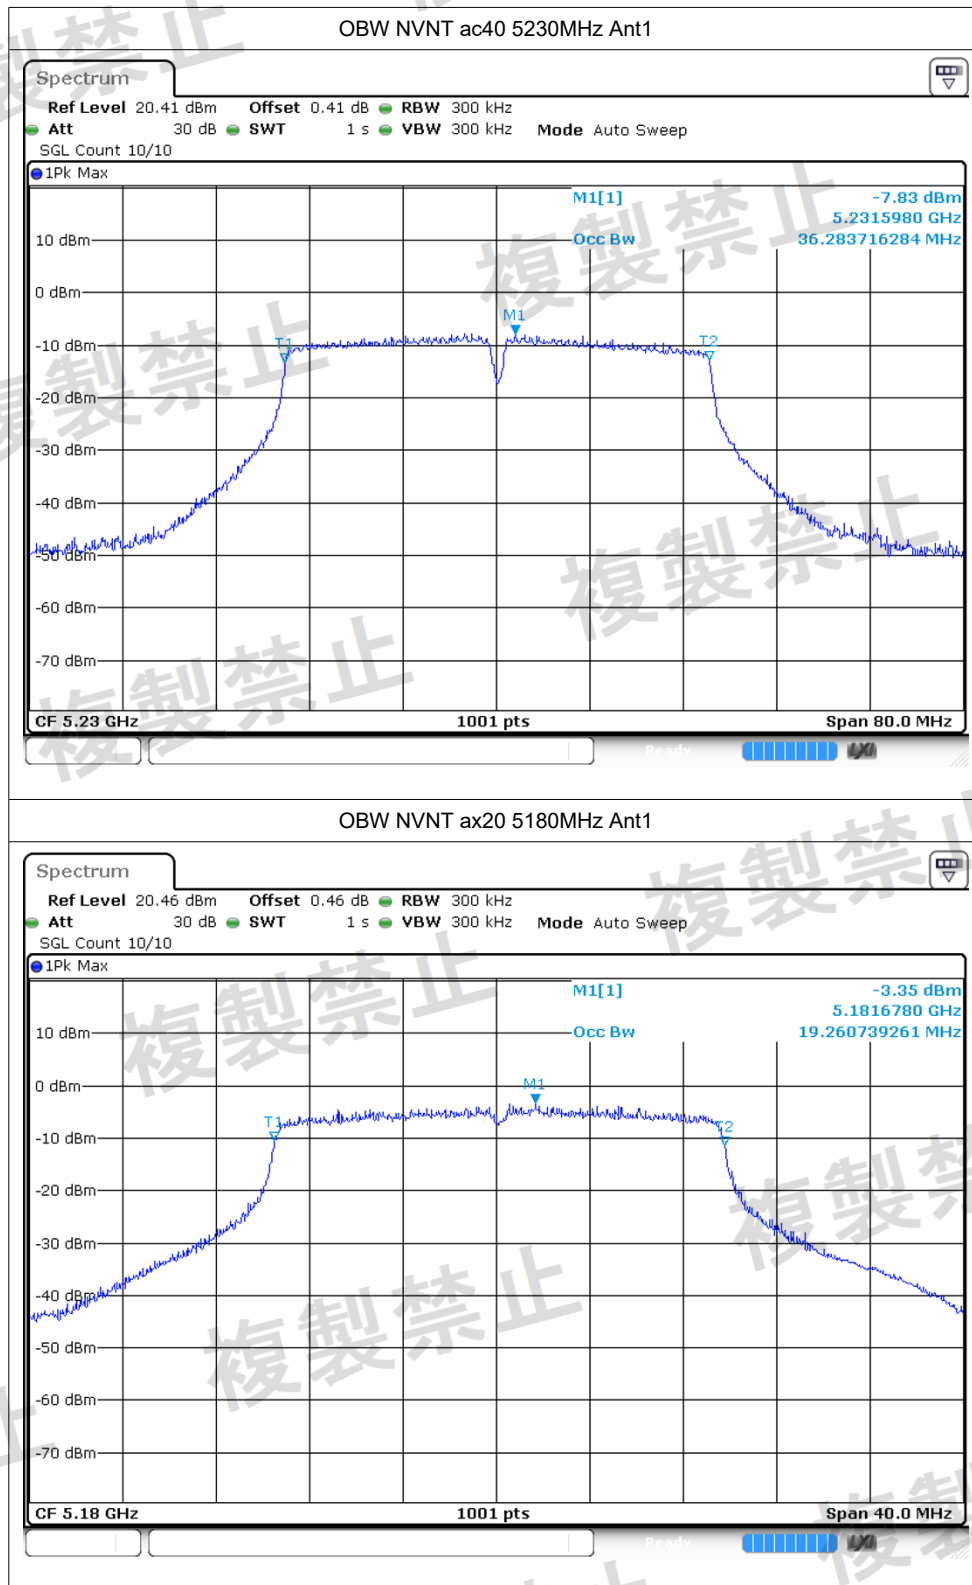

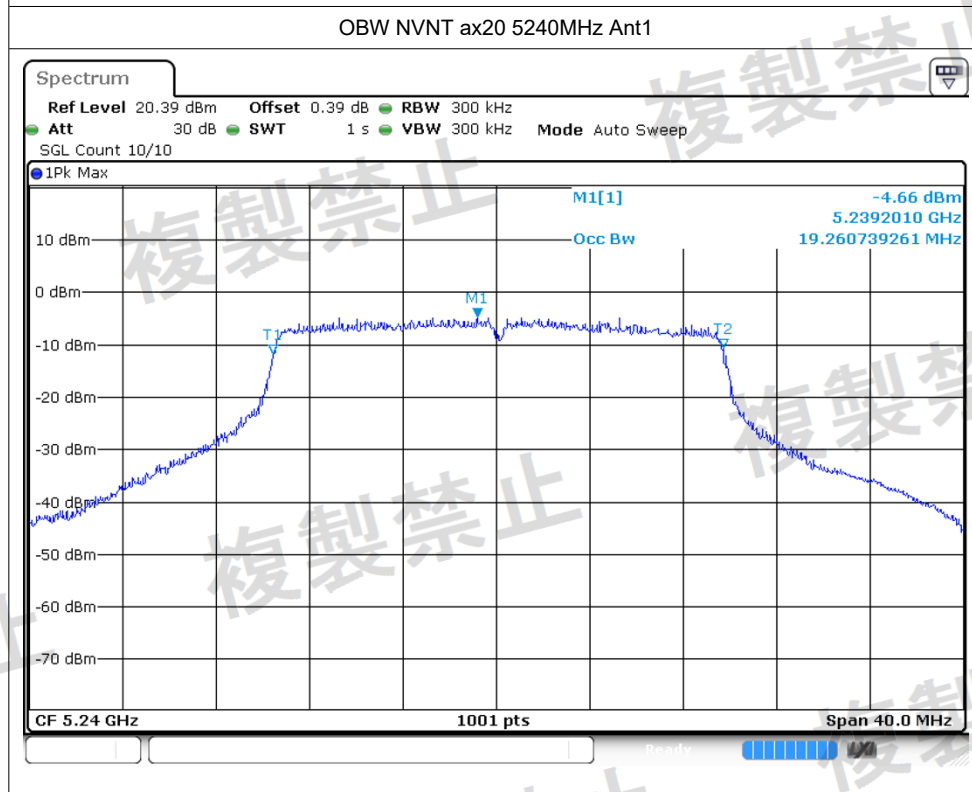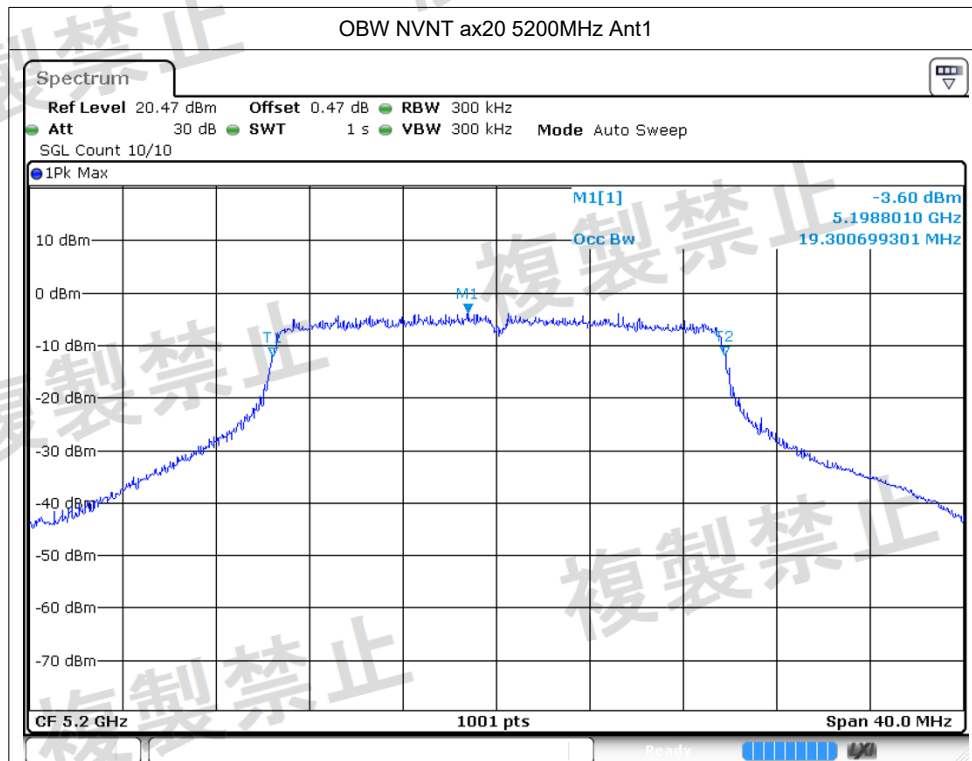

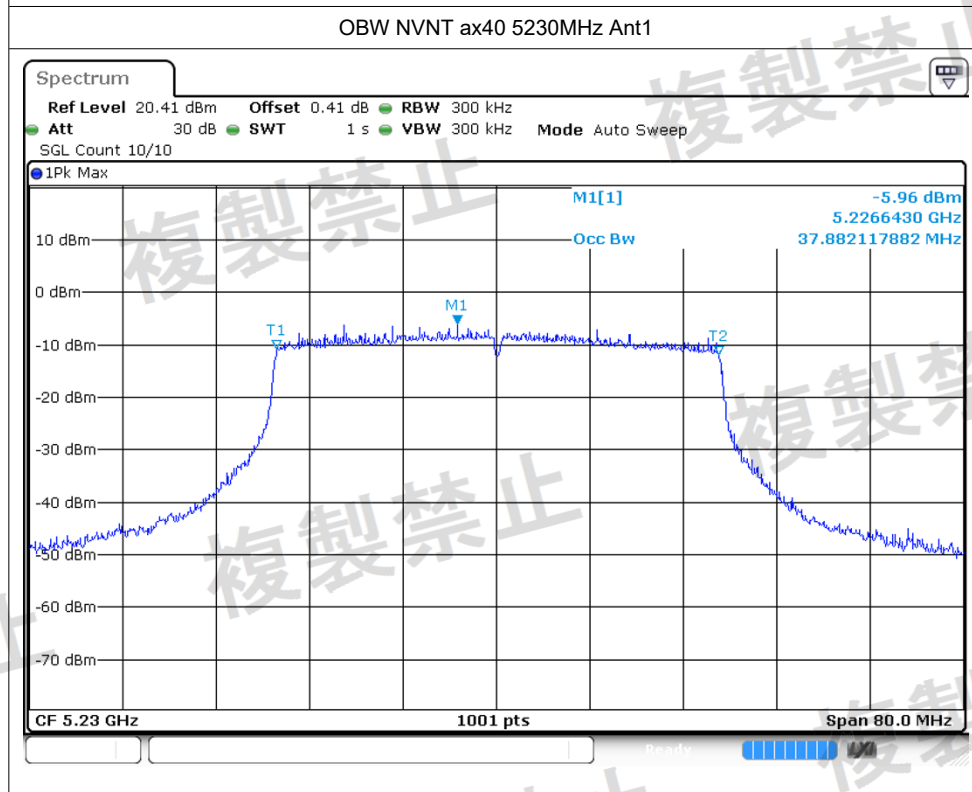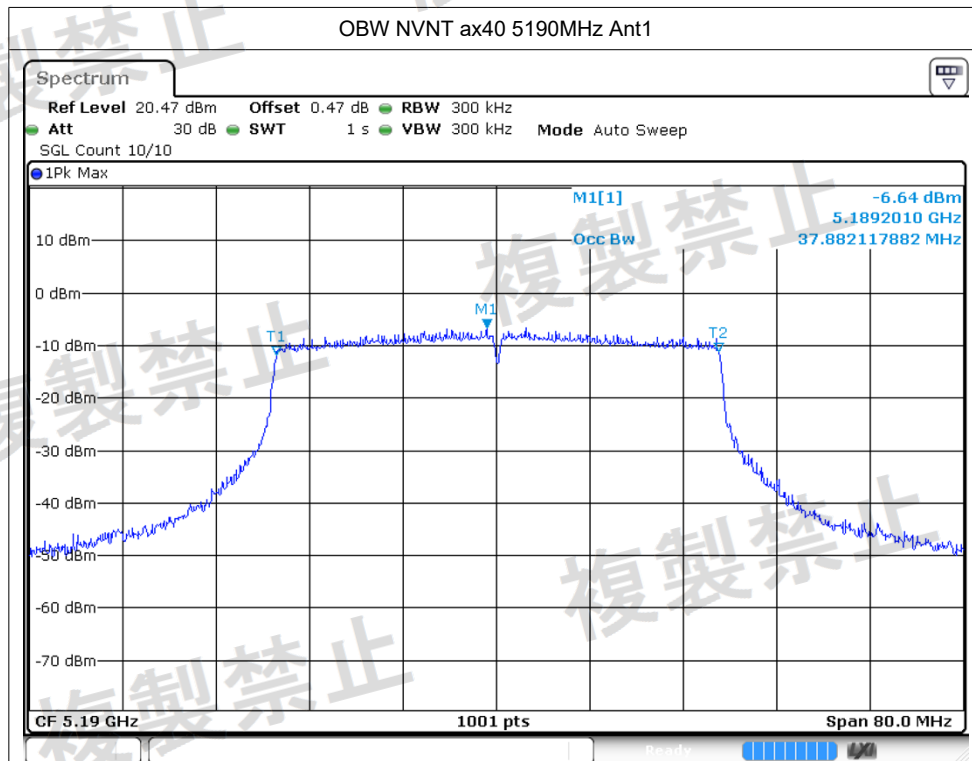


Spreading Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	90% OBW (MHz)	Limit (MHz)	Verdict
NVNT	a	5180	Ant1	14.785	0.5	Pass
NVNT	a	5200	Ant1	14.625	0.5	Pass
NVNT	a	5240	Ant1	14.585	0.5	Pass
NVNT	n20	5180	Ant1	15.744	0.5	Pass
NVNT	n20	5200	Ant1	15.704	0.5	Pass
NVNT	n20	5240	Ant1	15.744	0.5	Pass
NVNT	n40	5190	Ant1	31.968	0.5	Pass
NVNT	n40	5230	Ant1	31.888	0.5	Pass
NVNT	ac20	5180	Ant1	15.504	0.5	Pass
NVNT	ac20	5200	Ant1	15.864	0.5	Pass
NVNT	ac20	5240	Ant1	15.824	0.5	Pass
NVNT	ac40	5190	Ant1	32.368	0.5	Pass
NVNT	ac40	5230	Ant1	31.968	0.5	Pass
NVNT	ax20	5180	Ant1	16.783	0.5	Pass
NVNT	ax20	5200	Ant1	16.743	0.5	Pass
NVNT	ax20	5240	Ant1	16.743	0.5	Pass
NVNT	ax40	5190	Ant1	33.167	0.5	Pass
NVNT	ax40	5230	Ant1	33.487	0.5	Pass


Test Graphs


Spreading Bandwidth NVNT a 5180MHz Ant1

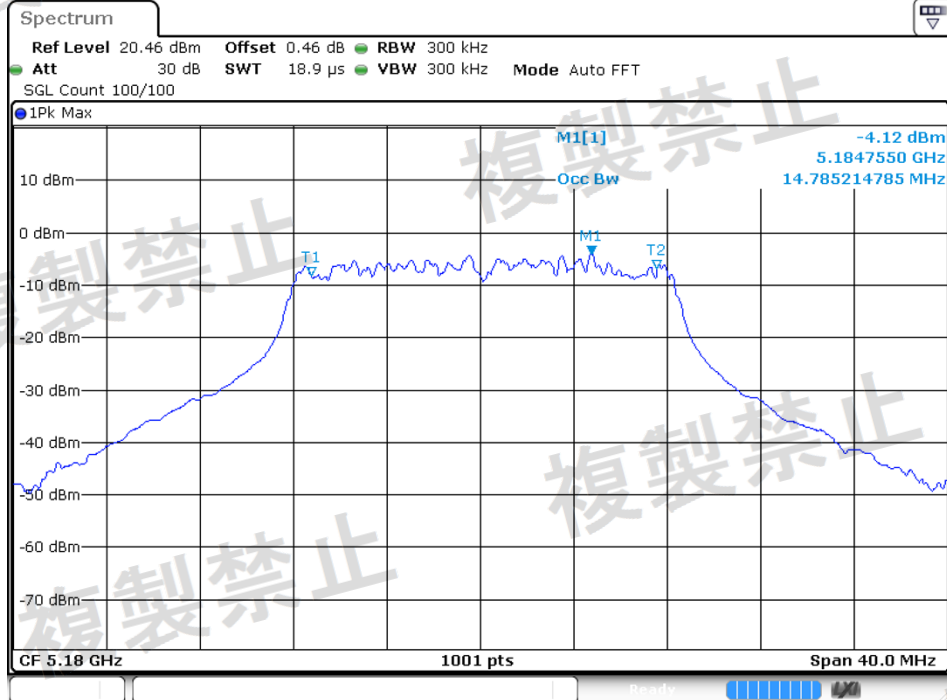




Spreading Bandwidth NVNT a 5200MHz Ant1


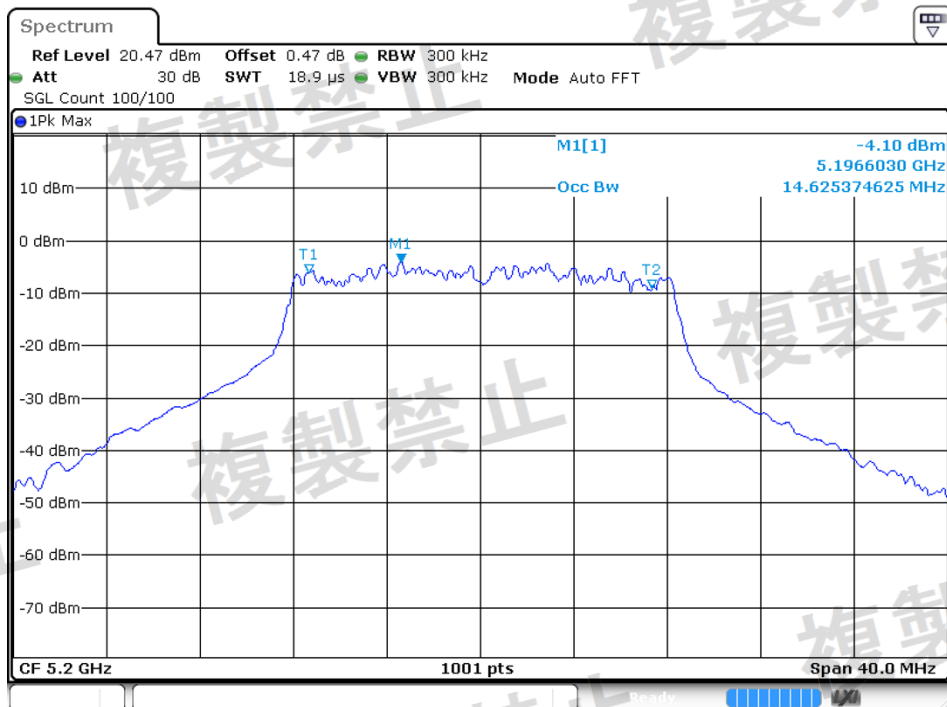


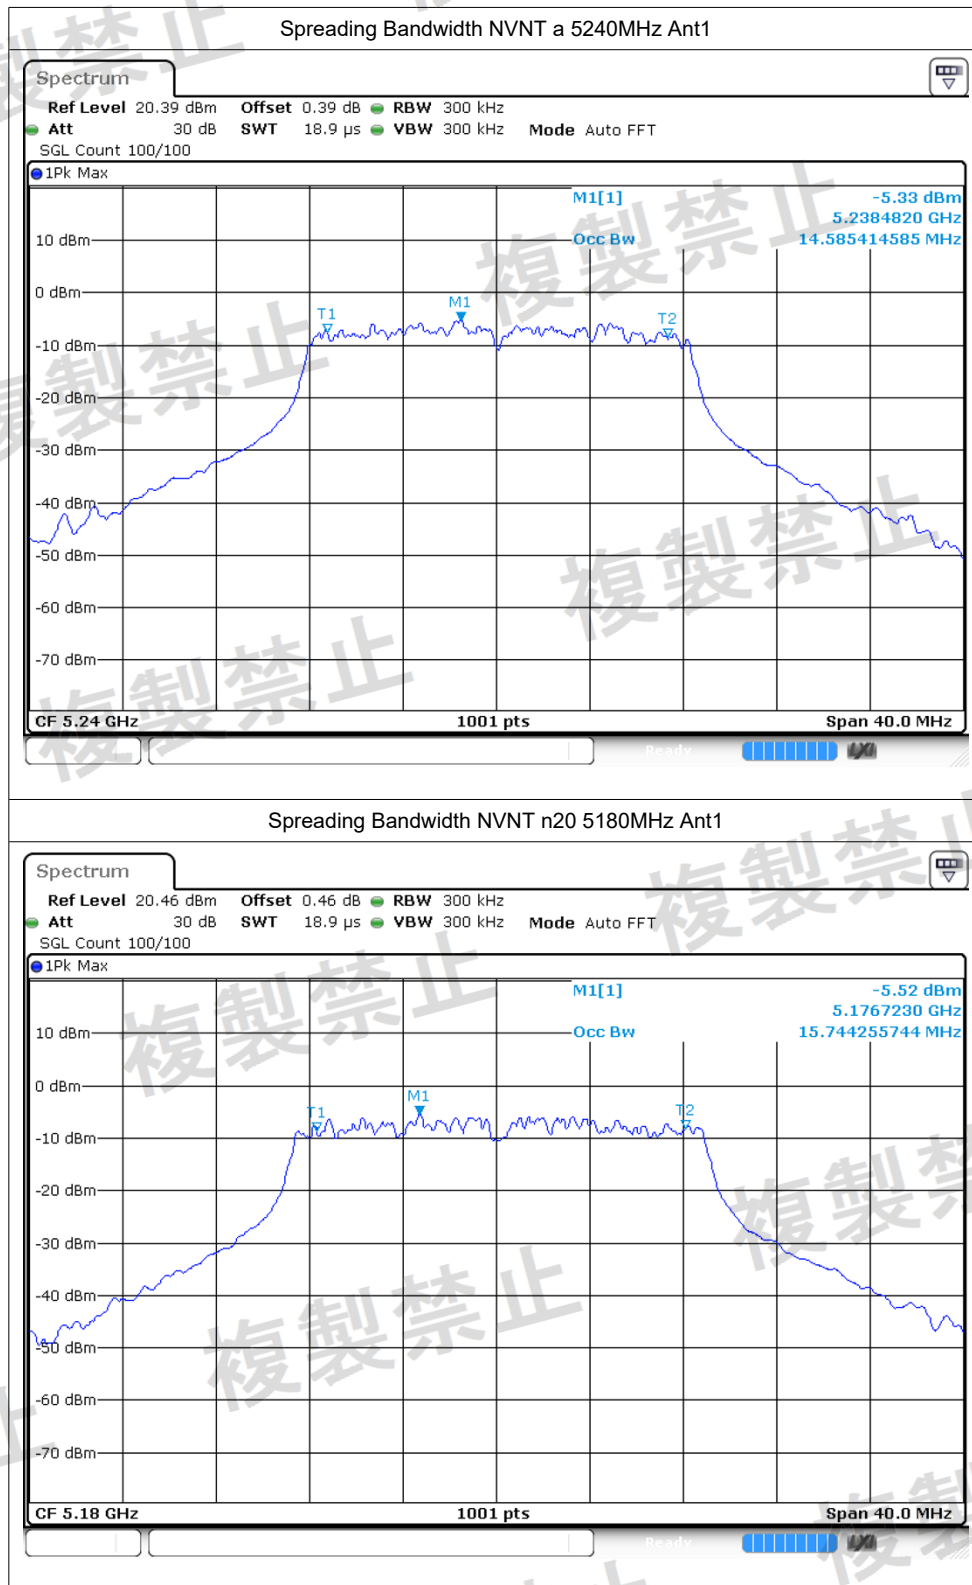



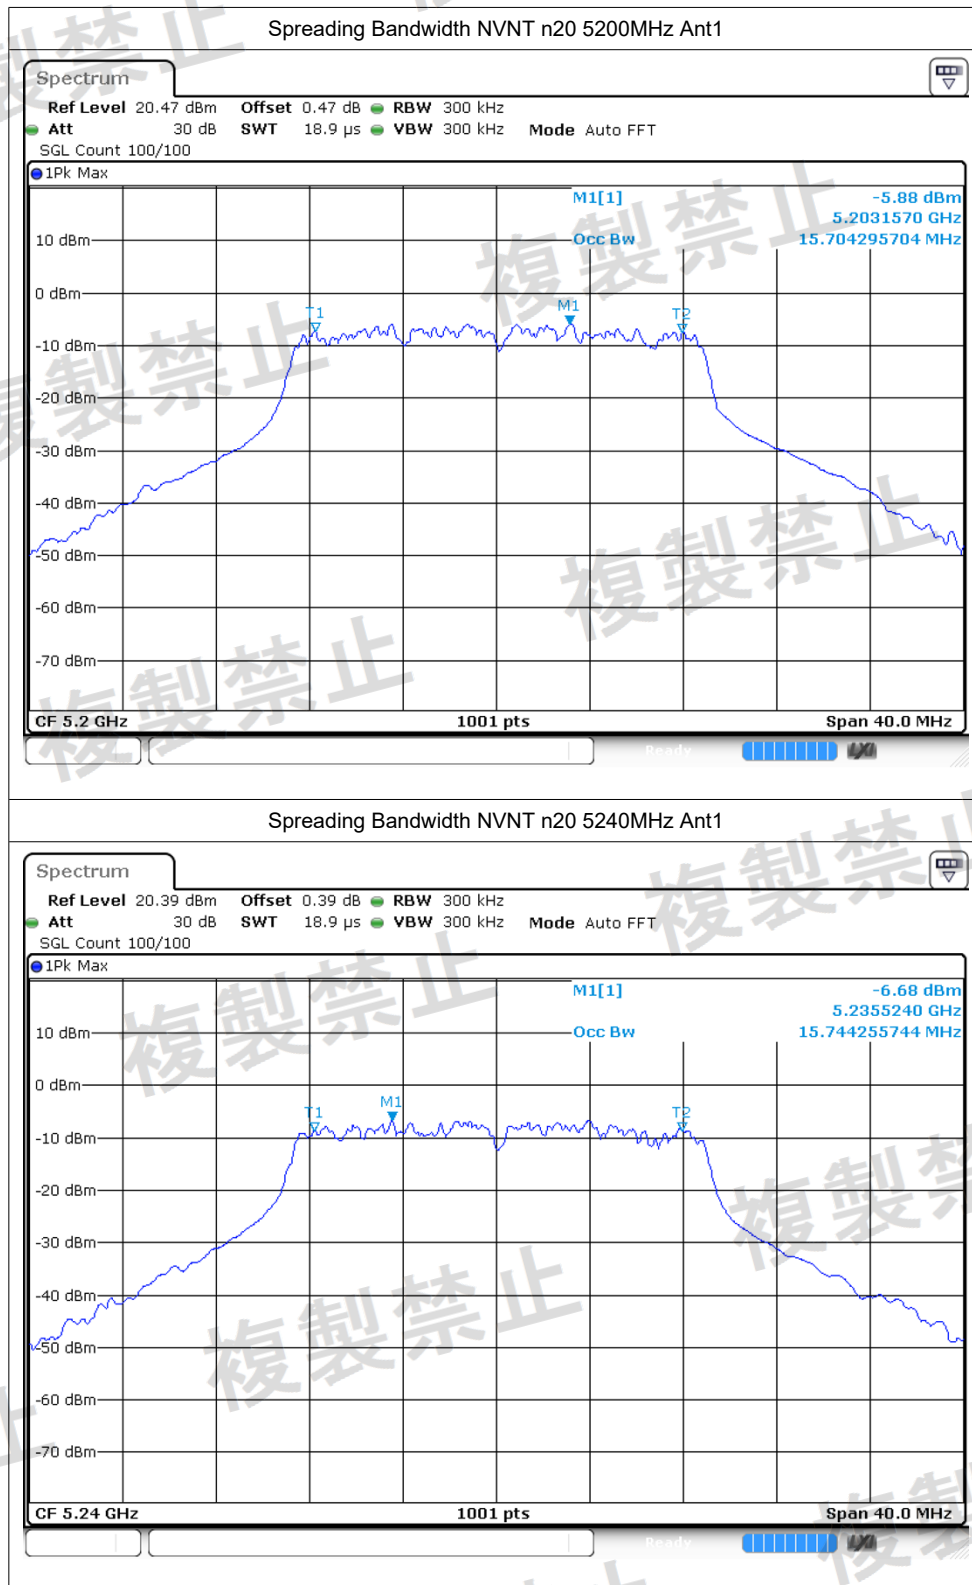



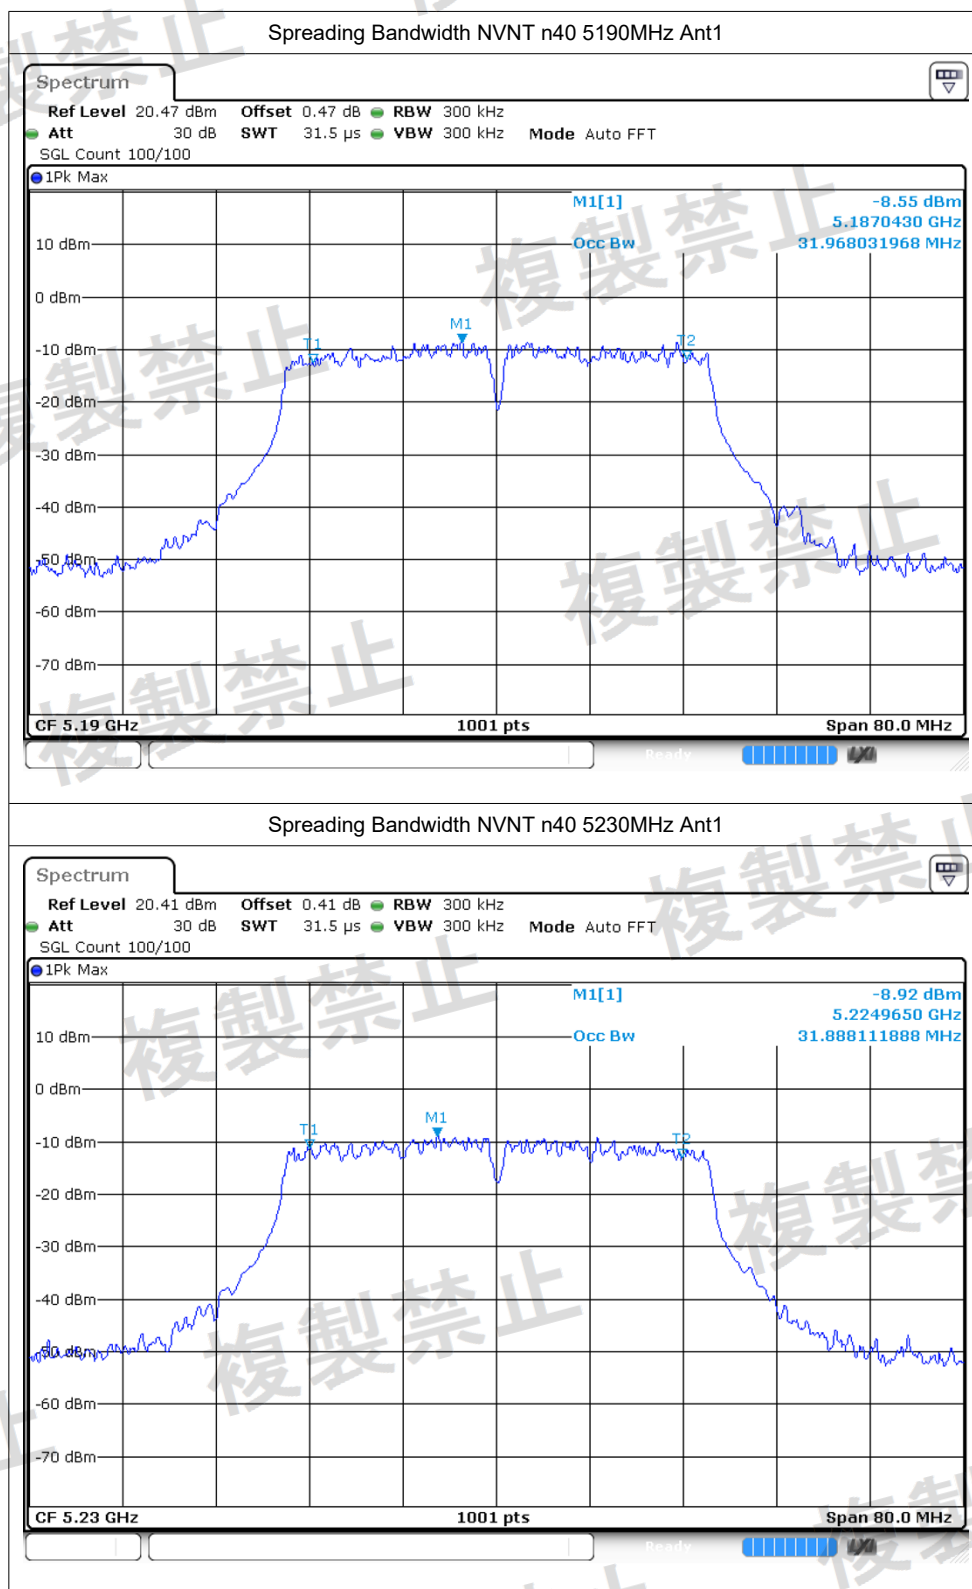


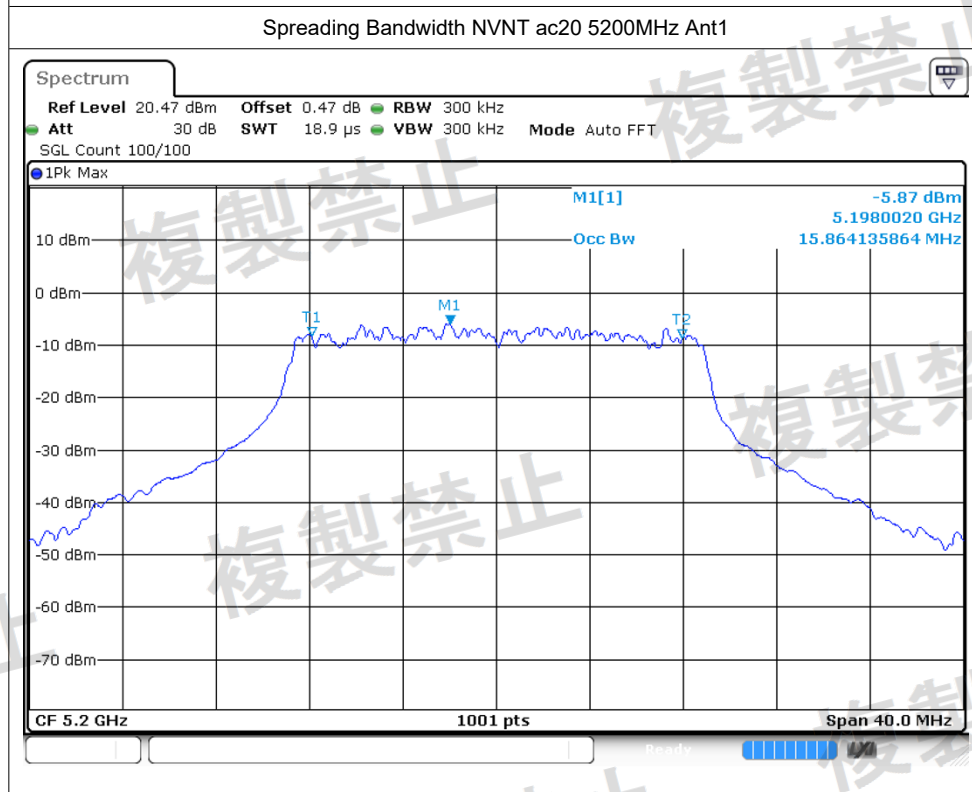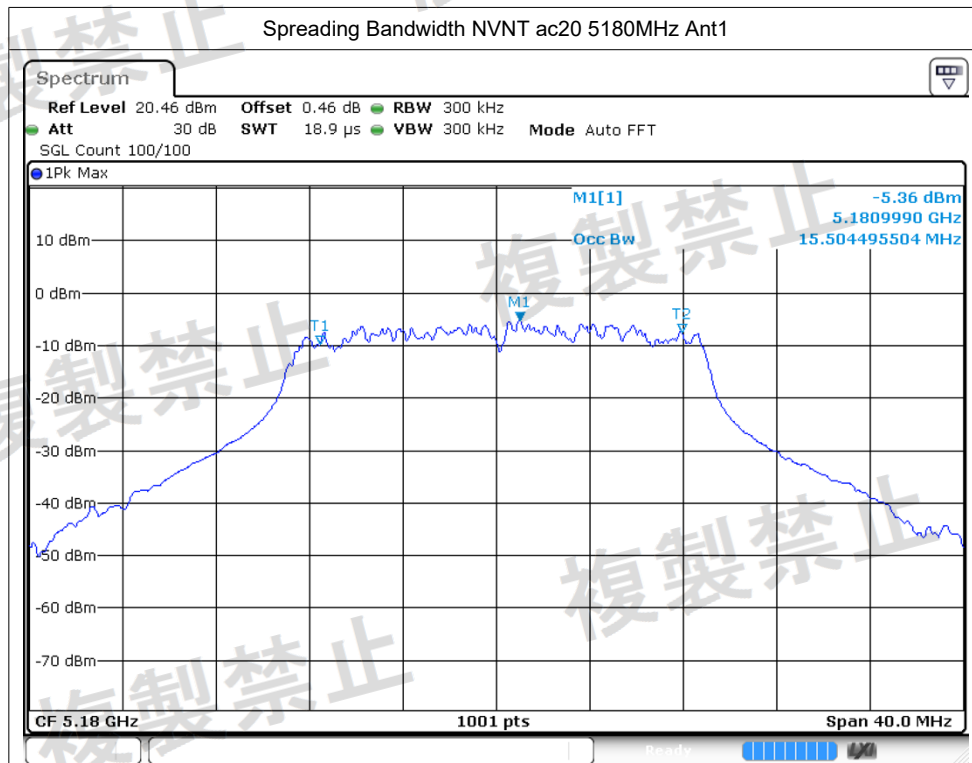

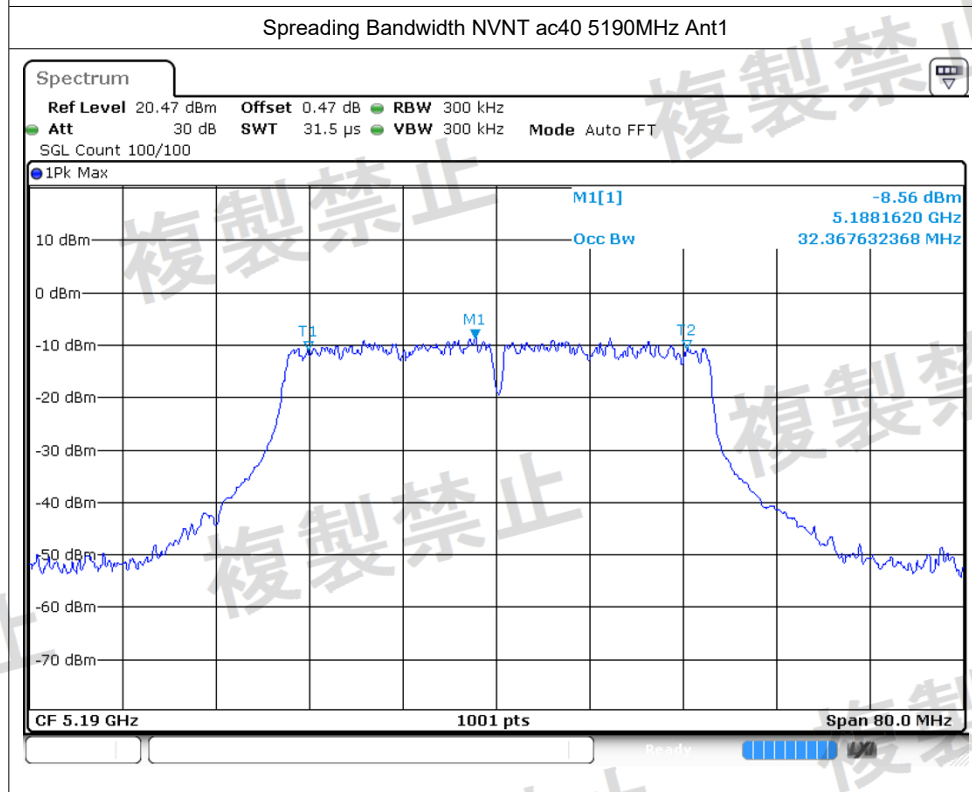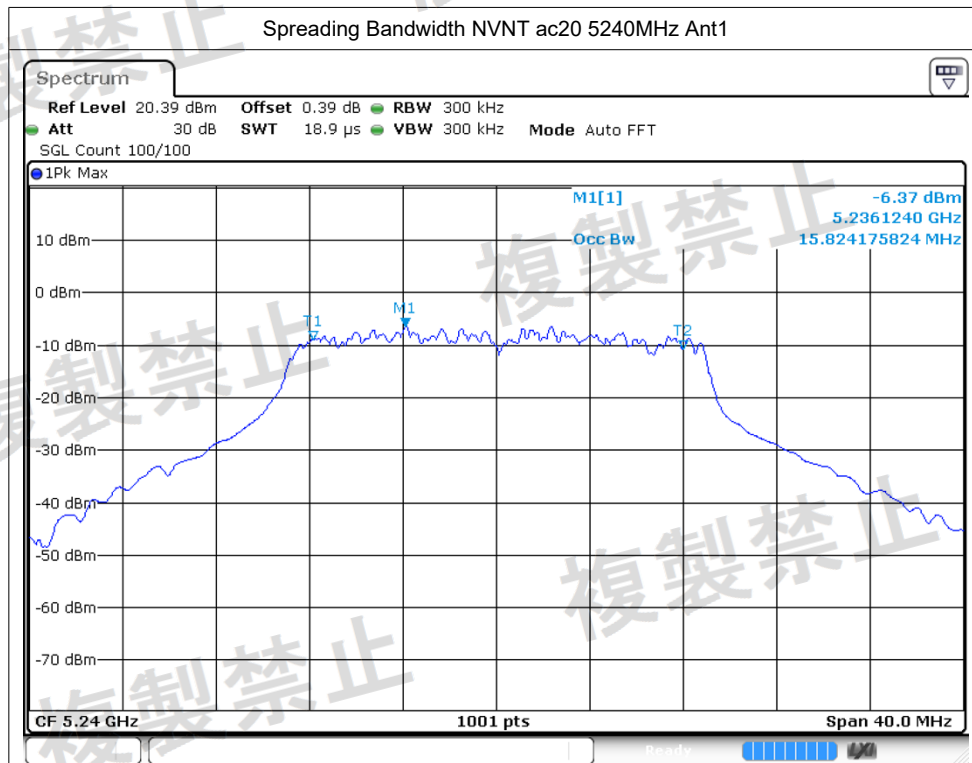

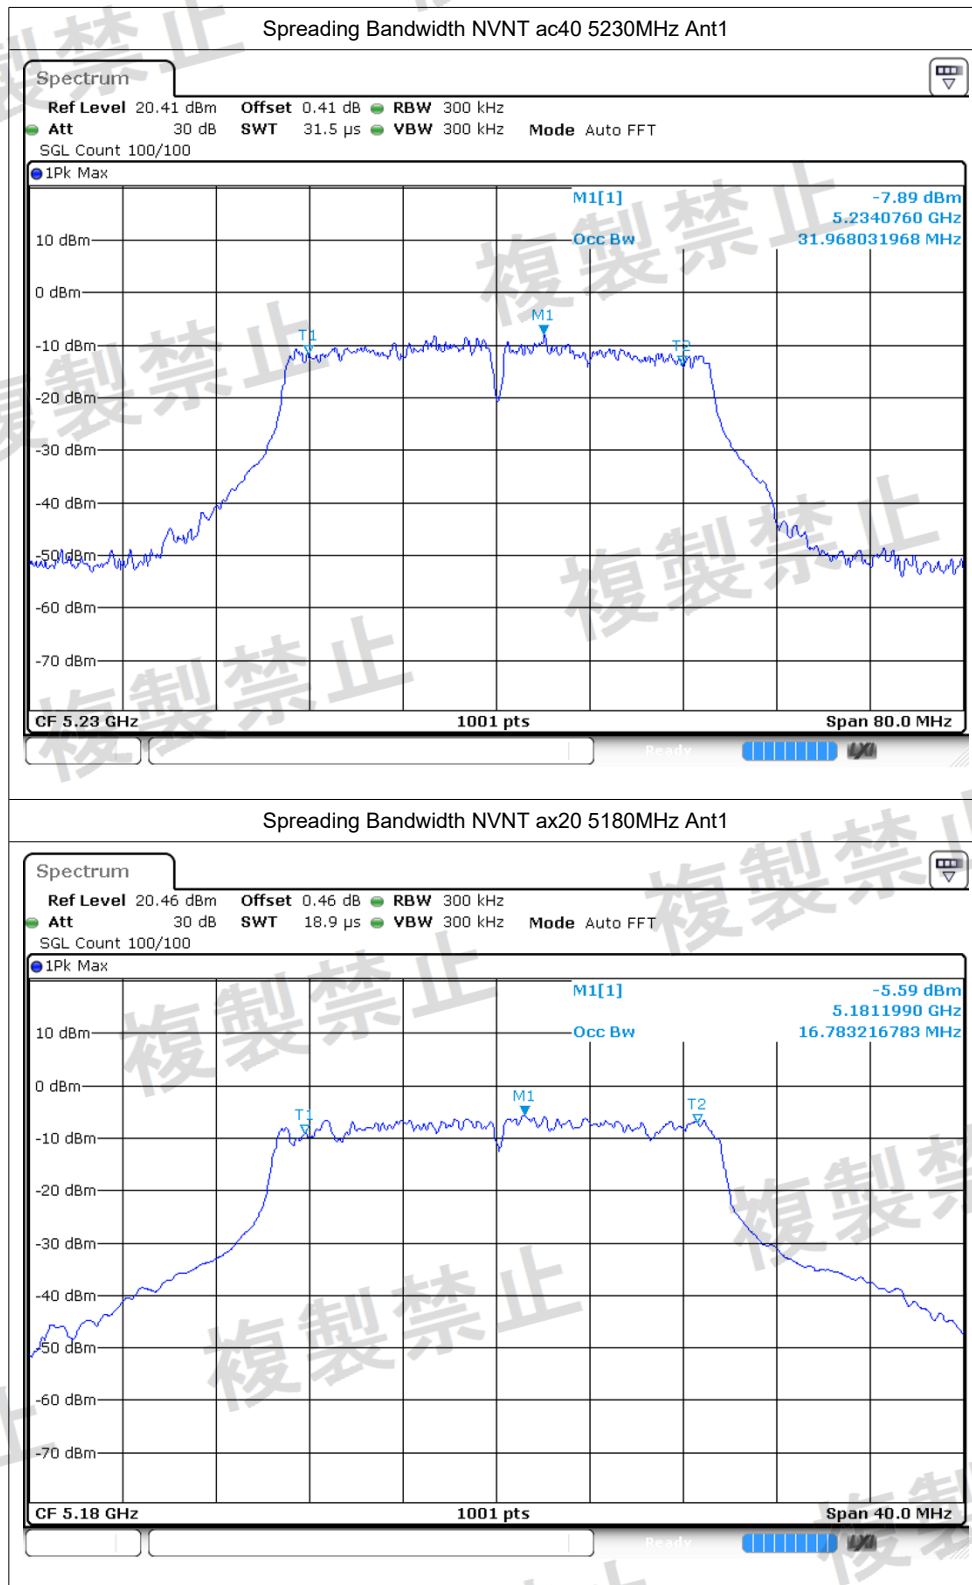

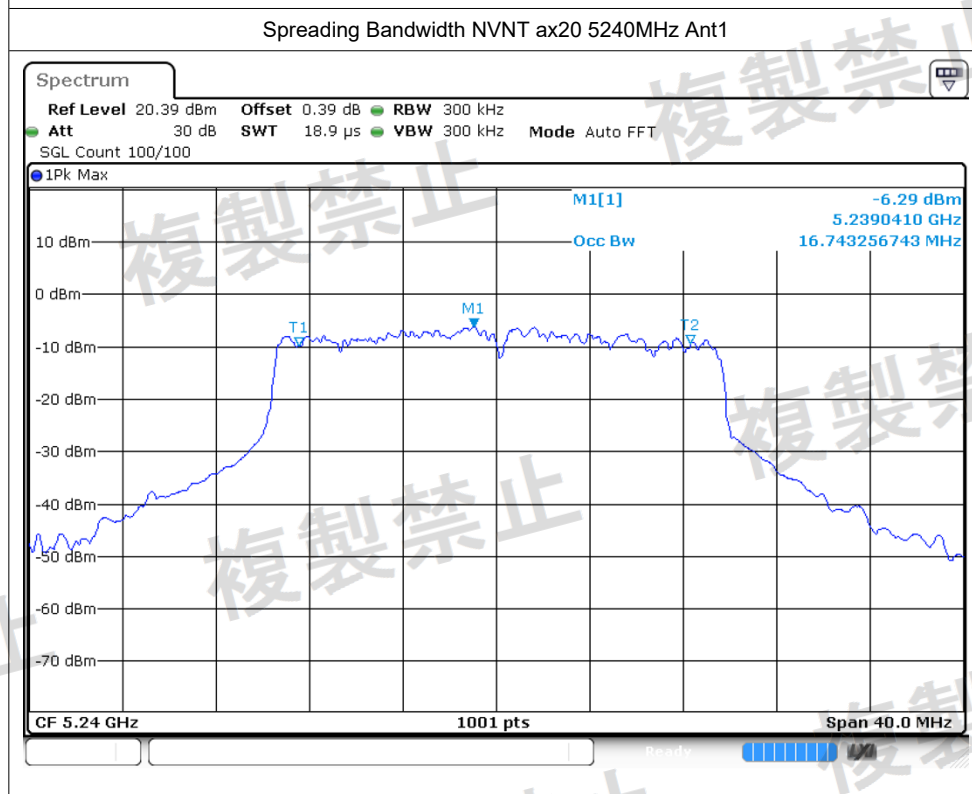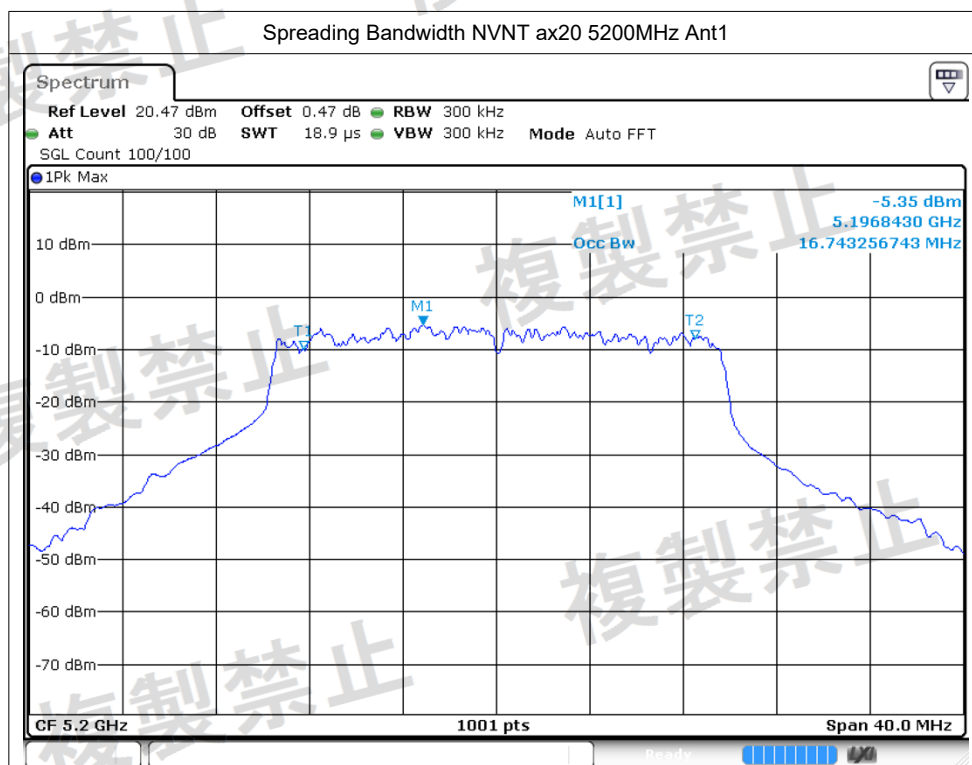

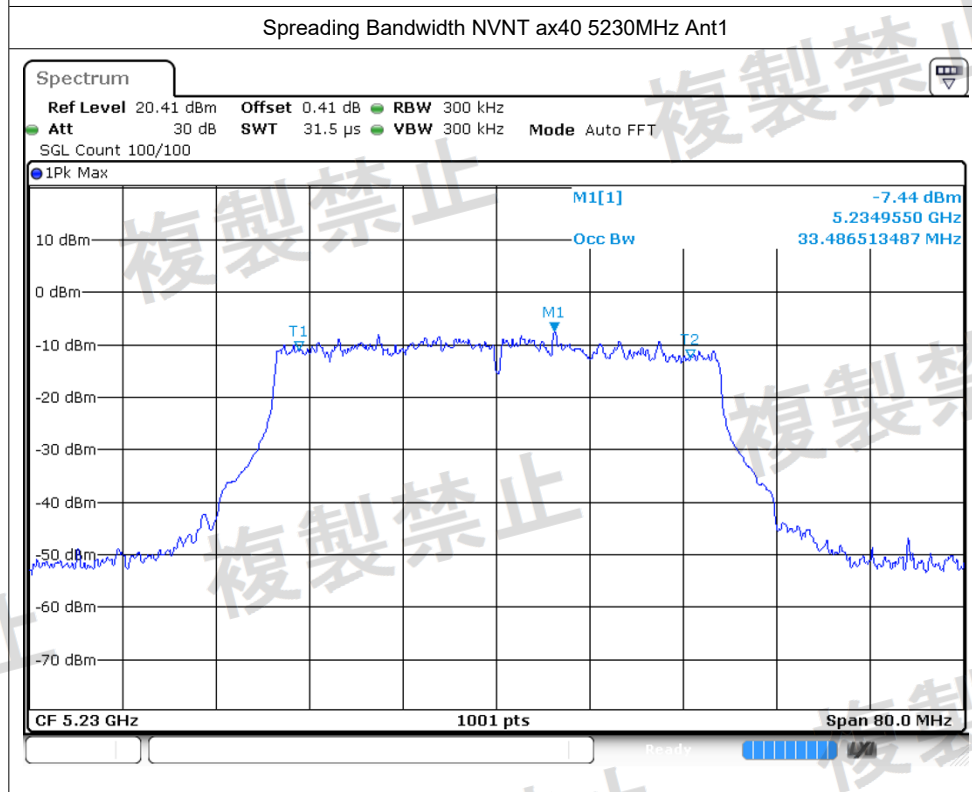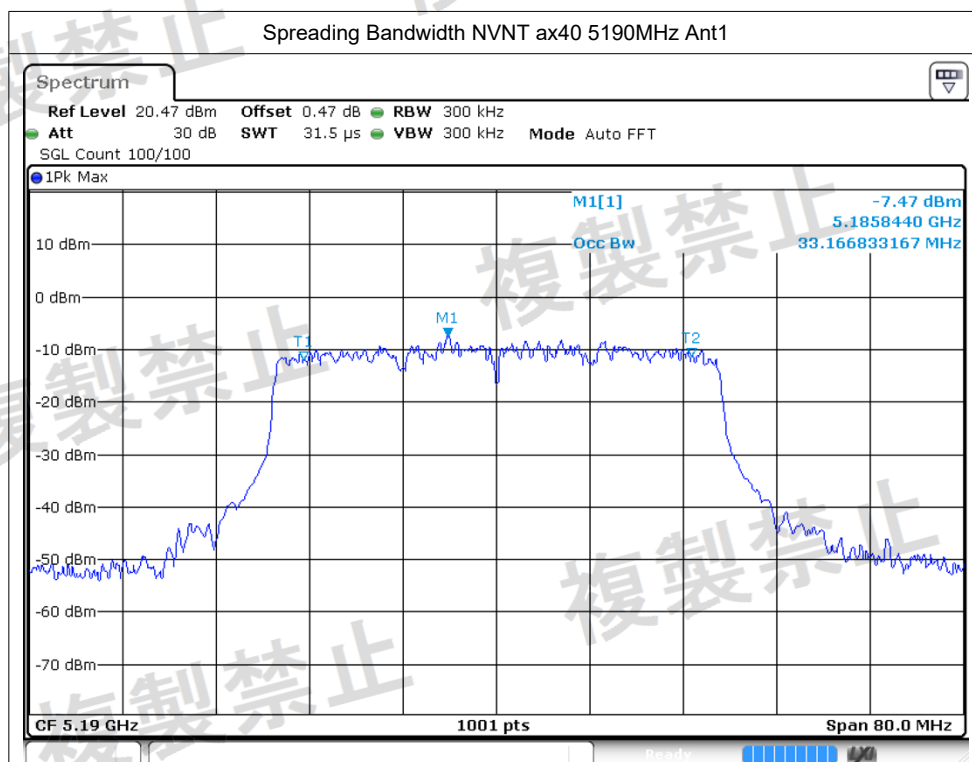



Tx Spurious Emission

Condition	Mode	Frequency (MHz)	Antenna	Range (MHz)	Emission Frequency (MHz)	Max Peak Value (dBm)	Max RMS Value (dBm)	Max Peak Value (uW)	Max RMS Value (uW)	Limit Start(uW)	Limit Stop (uW)	Verdict
NVNT	a	5180	Ant1	30-1000	870.12	-57.49	NA	0.0018	NA	2.5	2.5	Pass
NVNT	a	5180	Ant1	1000-5142	3538.22	-47.70	NA	0.017	NA	2.5	2.5	Pass
NVNT	a	5180	Ant1	5142-5150	5149.92	-52.63	NA	0.0055	NA	15	15	Pass
NVNT	a	5180	Ant1	5250-5251	5251.00	-57.22	NA	0.0019	NA	1000	100	Pass
NVNT	a	5180	Ant1	5251-5260	5258.07	-55.50	NA	0.0028	NA	100	15.85	Pass
NVNT	a	5180	Ant1	5260-5266.7	5266.70	-56.32	NA	0.0023	NA	15.85	2.49	Pass
NVNT	a	5180	Ant1	5266.7-26000	19365.34	-42.56	NA	0.0555	NA	2.5	2.5	Pass
NVNT	a	5200	Ant1	30-1000	912.02	-57.53	NA	0.0018	NA	2.5	2.5	Pass
NVNT	a	5200	Ant1	1000-5142	3583.37	-47.16	NA	0.0192	NA	2.5	2.5	Pass
NVNT	a	5200	Ant1	5142-5150	5143.17	-54.84	NA	0.0033	NA	15	15	Pass
NVNT	a	5200	Ant1	5250-5251	5251.00	-53.26	NA	0.0047	NA	1000	100	Pass
NVNT	a	5200	Ant1	5251-5260	5260.00	-56.78	NA	0.0021	NA	100	15.85	Pass
NVNT	a	5200	Ant1	5260-5266.7	5266.42	-55.95	NA	0.0025	NA	15.85	2.49	Pass
NVNT	a	5200	Ant1	5266.7-26000	10396.12	-44.77	NA	0.0333	NA	2.5	2.5	Pass
NVNT	a	5240	Ant1	30-1000	992.05	-57.50	NA	0.0018	NA	2.5	2.5	Pass
NVNT	a	5240	Ant1	1000-5142	3401.95	-52.67	NA	0.0054	NA	2.5	2.5	Pass
NVNT	a	5240	Ant1	5142-5150	5143.57	-56.25	NA	0.0024	NA	15	15	Pass
NVNT	a	5240	Ant1	5250-5251	5251.00	-20.78	NA	8.356	NA	1000	100	Pass
NVNT	a	5240	Ant1	5251-5260	5251.00	-17.61	NA	17.338	NA	100	15.85	Pass
NVNT	a	5240	Ant1	5260-5266.7	5260.00	-37.70	NA	0.1698	NA	15.85	2.49	Pass
NVNT	a	5240	Ant1	5266.7-26000	10476.98	-44.25	NA	0.0376	NA	2.5	2.5	Pass
NVNT	n20	5180	Ant1	30-1000	795.04	-57.61	NA	0.0017	NA	2.5	2.5	Pass
NVNT	n20	5180	Ant1	1000-5142	3498.04	-47.71	NA	0.0169	NA	2.5	2.5	Pass
NVNT	n20	5180	Ant1	5142-5150	5149.90	-49.48	NA	0.0113	NA	15	15	Pass
NVNT	n20	5180	Ant1	5250-5250.2	5250.20	-58.99	NA	0.0013	NA	2154.43	630.96	Pass
NVNT	n20	5180	Ant1	5250.2-5251	5251.00	-56.44	NA	0.0023	NA	630.96	100	Pass
NVNT	n20	5180	Ant1	5251-5260	5258.23	-56.06	NA	0.0025	NA	100	15.85	Pass
NVNT	n20	5180	Ant1	5260-5266.7	5266.70	-57.20	NA	0.0019	NA	15.85	2.49	Pass
NVNT	n20	5180	Ant1	5266.7-26000	19338.39	-44.83	NA	0.0329	NA	2.5	2.5	Pass
NVNT	n20	5200	Ant1	30-1000	806.19	-57.37	NA	0.0018	NA	2.5	2.5	Pass
NVNT	n20	5200	Ant1	1000-5142	3502.60	-54.32	NA	0.0037	NA	2.5	2.5	Pass
NVNT	n20	5200	Ant1	5142-5150	5147.13	-54.61	NA	0.0035	NA	15	15	Pass
NVNT	n20	5200	Ant1	5250-5250.2	5250.20	-57.08	NA	0.002	NA	2154.43	630.96	Pass
NVNT	n20	5200	Ant1	5250.2-5251	5251.00	-54.80	NA	0.0033	NA	630.96	100	Pass
NVNT	n20	5200	Ant1	5251-5260	5260.00	-56.70	NA	0.0021	NA	100	15.85	Pass
NVNT	n20	5200	Ant1	5260-5266.7	5266.11	-56.79	NA	0.0021	NA	15.85	2.49	Pass
NVNT	n20	5200	Ant1	5266.7-26000	19334.24	-45.23	NA	0.03	NA	2.5	2.5	Pass



NVNT	n20	5240	Ant1	30-1000	359.41	-57.52	NA	0.0018	NA	2.5	2.5	Pass
NVNT	n20	5240	Ant1	1000-5142	3498.04	-41.24	NA	0.0752	NA	2.5	2.5	Pass
NVNT	n20	5240	Ant1	5142-5150	5144.65	-53.95	NA	0.004	NA	15	15	Pass
NVNT	n20	5240	Ant1	5250-5250.2	5250.20	-19.11	NA	12.2744	NA	2154.43	630.96	Pass
NVNT	n20	5240	Ant1	5250.2-5251	5251.00	-22.90	NA	5.1286	NA	630.96	100	Pass
NVNT	n20	5240	Ant1	5251-5260	5251.00	-18.60	NA	13.8038	NA	100	15.85	Pass
NVNT	n20	5240	Ant1	5260-5266.7	5264.81	-46.04	NA	0.0249	NA	15.85	2.49	Pass
NVNT	n20	5240	Ant1	5266.7-26000	19359.12	-45.05	NA	0.0313	NA	2.5	2.5	Pass
NVNT	n40	5190	Ant1	30-1000	974.78	-57.38	NA	0.0018	NA	2.5	2.5	Pass
NVNT	n40	5190	Ant1	1000-5141.6	5141.60	-49.62	NA	0.0109	NA	2.5	2.5	Pass
NVNT	n40	5190	Ant1	5141.6-5150	5147.29	-50.52	NA	0.0089	NA	15	15	Pass
NVNT	n40	5190	Ant1	5250-5251	5251.00	-55.23	NA	0.003	NA	500	50	Pass
NVNT	n40	5190	Ant1	5251-5270	5262.11	-54.01	NA	0.004	NA	50	7.92	Pass
NVNT	n40	5190	Ant1	5270-5278.4	5278.15	-55.43	NA	0.0029	NA	7.92	2.48	Pass
NVNT	n40	5190	Ant1	5278.4-26000	19348.37	-44.69	NA	0.034	NA	2.5	2.5	Pass
NVNT	n40	5230	Ant1	30-1000	815.31	-57.66	NA	0.0017	NA	2.5	2.5	Pass
NVNT	n40	5230	Ant1	1000-5141.6	4355.52	-54.54	NA	0.0035	NA	2.5	2.5	Pass
NVNT	n40	5230	Ant1	5141.6-5150	5148.06	-55.55	NA	0.0028	NA	15	15	Pass
NVNT	n40	5230	Ant1	5250-5251	5251.00	-26.23	NA	2.3823	NA	500	50	Pass
NVNT	n40	5230	Ant1	5251-5270	5251.00	-28.40	NA	1.4454	NA	50	7.92	Pass
NVNT	n40	5230	Ant1	5270-5278.4	5278.24	-51.25	NA	0.0075	NA	7.92	2.48	Pass
NVNT	n40	5230	Ant1	5278.4-26000	16341.66	-44.95	NA	0.032	NA	2.5	2.5	Pass
NVNT	ac20	5180	Ant1	30-1000	922.01	-56.78	NA	0.0021	NA	2.5	2.5	Pass
NVNT	ac20	5180	Ant1	1000-5142	5135.37	-50.17	NA	0.0096	NA	2.5	2.5	Pass
NVNT	ac20	5180	Ant1	5142-5150	5145.96	-50.31	NA	0.0093	NA	15	15	Pass
NVNT	ac20	5180	Ant1	5250-5250.2	5250.20	-57.28	NA	0.0019	NA	2154.43	630.96	Pass
NVNT	ac20	5180	Ant1	5250.2-5251	5251.00	-56.48	NA	0.0022	NA	630.96	100	Pass
NVNT	ac20	5180	Ant1	5251-5260	5260.00	-58.29	NA	0.0015	NA	100	15.85	Pass
NVNT	ac20	5180	Ant1	5260-5266.7	5266.50	-56.38	NA	0.0023	NA	15.85	2.49	Pass
NVNT	ac20	5180	Ant1	5266.7-26000	19334.24	-44.48	NA	0.0356	NA	2.5	2.5	Pass
NVNT	ac20	5200	Ant1	30-1000	997.58	-57.05	NA	0.002	NA	2.5	2.5	Pass
NVNT	ac20	5200	Ant1	1000-5142	4949.81	-54.69	NA	0.0034	NA	2.5	2.5	Pass
NVNT	ac20	5200	Ant1	5142-5150	5148.95	-55.34	NA	0.0029	NA	15	15	Pass
NVNT	ac20	5200	Ant1	5250-5250.2	5250.20	-57.59	NA	0.0017	NA	2154.43	630.96	Pass
NVNT	ac20	5200	Ant1	5250.2-5251	5251.00	-56.84	NA	0.0021	NA	630.96	100	Pass
NVNT	ac20	5200	Ant1	5251-5260	5259.03	-55.56	NA	0.0028	NA	100	15.85	Pass
NVNT	ac20	5200	Ant1	5260-5266.7	5266.70	-56.42	NA	0.0023	NA	15.85	2.49	Pass
NVNT	ac20	5200	Ant1	5266.7-26000	19342.54	-44.78	NA	0.0333	NA	2.5	2.5	Pass
NVNT	ac20	5240	Ant1	30-1000	728.40	-57.58	NA	0.0017	NA	2.5	2.5	Pass
NVNT	ac20	5240	Ant1	1000-5142	4966.79	-54.70	NA	0.0034	NA	2.5	2.5	Pass
NVNT	ac20	5240	Ant1	5142-5150	5147.30	-57.32	NA	0.0019	NA	15	15	Pass
NVNT	ac20	5240	Ant1	5250-5250.2	5250.20	-18.85	NA	13.0317	NA	2154.43	630.96	Pass
NVNT	ac20	5240	Ant1	5250.2-5251	5251.00	-20.50	NA	8.9125	NA	630.96	100	Pass
NVNT	ac20	5240	Ant1	5251-5260	5251.00	-20.71	NA	8.4918	NA	100	15.85	Pass




NVNT	ac20	5240	Ant1	5260-5266.7	5264.53	-47.96	NA	0.016	NA	15.85	2.49	Pass
NVNT	ac20	5240	Ant1	5266.7-26000	19348.76	-45.19	NA	0.0303	NA	2.5	2.5	Pass
NVNT	ac40	5190	Ant1	30-1000	921.53	-57.33	NA	0.0018	NA	2.5	2.5	Pass
NVNT	ac40	5190	Ant1	1000-5141.6	5141.19	-53.47	NA	0.0045	NA	2.5	2.5	Pass
NVNT	ac40	5190	Ant1	5141.6-5150	5141.92	-51.77	NA	0.0067	NA	15	15	Pass
NVNT	ac40	5190	Ant1	5250-5251	5251.00	-57.02	NA	0.002	NA	500	50	Pass
NVNT	ac40	5190	Ant1	5251-5270	5265.46	-54.54	NA	0.0035	NA	50	7.92	Pass
NVNT	ac40	5190	Ant1	5270-5278.4	5277.74	-56.07	NA	0.0025	NA	7.92	2.48	Pass
NVNT	ac40	5190	Ant1	5278.4-26000	19331.79	-45.07	NA	0.0311	NA	2.5	2.5	Pass
NVNT	ac40	5230	Ant1	30-1000	898.15	-57.00	NA	0.002	NA	2.5	2.5	Pass
NVNT	ac40	5230	Ant1	1000-5141.6	3517.68	-34.38	NA	0.3648	NA	2.5	2.5	Pass
NVNT	ac40	5230	Ant1	5141.6-5150	5142.84	-56.11	NA	0.0024	NA	15	15	Pass
NVNT	ac40	5230	Ant1	5250-5251	5251.00	-25.88	NA	2.5823	NA	500	50	Pass
NVNT	ac40	5230	Ant1	5251-5270	5251.00	-25.48	NA	2.8314	NA	50	7.92	Pass
NVNT	ac40	5230	Ant1	5270-5278.4	5275.81	-51.30	NA	0.0074	NA	7.92	2.48	Pass
NVNT	ac40	5230	Ant1	5278.4-26000	19325.57	-45.19	NA	0.0303	NA	2.5	2.5	Pass
NVNT	ax20	5180	Ant1	30-1000	887.58	-56.52	NA	0.0022	NA	2.5	2.5	Pass
NVNT	ax20	5180	Ant1	1000-5142	3403.19	-50.32	NA	0.0093	NA	2.5	2.5	Pass
NVNT	ax20	5180	Ant1	5142-5150	5146.85	-50.36	NA	0.0092	NA	15	15	Pass
NVNT	ax20	5180	Ant1	5250-5250.2	5250.20	-56.13	NA	0.0024	NA	2154.43	630.96	Pass
NVNT	ax20	5180	Ant1	5250.2-5251	5251.00	-56.28	NA	0.0024	NA	630.96	100	Pass
NVNT	ax20	5180	Ant1	5251-5260	5259.29	-57.38	NA	0.0018	NA	100	15.85	Pass
NVNT	ax20	5180	Ant1	5260-5266.7	5266.27	-57.25	NA	0.0019	NA	15.85	2.49	Pass
NVNT	ax20	5180	Ant1	5266.7-26000	19336.32	-43.47	NA	0.045	NA	2.5	2.5	Pass
NVNT	ax20	5200	Ant1	30-1000	856.73	-56.46	NA	0.0023	NA	2.5	2.5	Pass
NVNT	ax20	5200	Ant1	1000-5142	5133.72	-54.11	NA	0.0039	NA	2.5	2.5	Pass
NVNT	ax20	5200	Ant1	5142-5150	5148.77	-54.01	NA	0.004	NA	15	15	Pass
NVNT	ax20	5200	Ant1	5250-5250.2	5250.20	-55.29	NA	0.003	NA	2154.43	630.96	Pass
NVNT	ax20	5200	Ant1	5250.2-5251	5251.00	-55.60	NA	0.0028	NA	630.96	100	Pass
NVNT	ax20	5200	Ant1	5251-5260	5259.91	-54.93	NA	0.0032	NA	100	15.85	Pass
NVNT	ax20	5200	Ant1	5260-5266.7	5266.70	-57.08	NA	0.002	NA	15.85	2.49	Pass
NVNT	ax20	5200	Ant1	5266.7-26000	19344.61	-44.40	NA	0.0363	NA	2.5	2.5	Pass
NVNT	ax20	5240	Ant1	30-1000	911.05	-57.61	NA	0.0017	NA	2.5	2.5	Pass
NVNT	ax20	5240	Ant1	1000-5142	3507.98	-51.80	NA	0.0066	NA	2.5	2.5	Pass
NVNT	ax20	5240	Ant1	5142-5150	5143.27	-55.41	NA	0.0029	NA	15	15	Pass
NVNT	ax20	5240	Ant1	5250-5250.2	5250.20	-13.03	NA	49.7737	NA	2154.43	630.96	Pass
NVNT	ax20	5240	Ant1	5250.2-5251	5251.00	-21.27	NA	7.4645	NA	630.96	100	Pass
NVNT	ax20	5240	Ant1	5251-5260	5251.00	-19.17	NA	12.106	NA	100	15.85	Pass
NVNT	ax20	5240	Ant1	5260-5266.7	5262.20	-43.91	NA	0.0406	NA	15.85	2.49	Pass
NVNT	ax20	5240	Ant1	5266.7-26000	19336.32	-44.94	NA	0.0321	NA	2.5	2.5	Pass
NVNT	ax40	5190	Ant1	30-1000	883.21	-57.27	NA	0.0019	NA	2.5	2.5	Pass
NVNT	ax40	5190	Ant1	1000-5141.6	5134.15	-50.53	NA	0.0089	NA	2.5	2.5	Pass
NVNT	ax40	5190	Ant1	5141.6-5150	5148.40	-49.56	NA	0.0111	NA	15	15	Pass
NVNT	ax40	5190	Ant1	5250-5251	5251.00	-56.31	NA	0.0023	NA	500	50	Pass

NVNT	ax40	5190	Ant1	5251-5270	5269.90	-55.99	NA	0.0025	NA	50	7.92	Pass
NVNT	ax40	5190	Ant1	5270-5278.4	5278.24	-57.12	NA	0.0019	NA	7.92	2.48	Pass
NVNT	ax40	5190	Ant1	5278.4-26000	19348.37	-44.69	NA	0.034	NA	2.5	2.5	Pass
NVNT	ax40	5230	Ant1	30-1000	901.84	-57.35	NA	0.0018	NA	2.5	2.5	Pass
NVNT	ax40	5230	Ant1	1000-5141.6	4980.91	-54.99	NA	0.0032	NA	2.5	2.5	Pass
NVNT	ax40	5230	Ant1	5141.6-5150	5149.21	-55.62	NA	0.0027	NA	15	15	Pass
NVNT	ax40	5230	Ant1	5250-5251	5251.00	-27.62	NA	1.7298	NA	500	50	Pass
NVNT	ax40	5230	Ant1	5251-5270	5251.00	-28.76	NA	1.3305	NA	50	7.92	Pass
NVNT	ax40	5230	Ant1	5270-5278.4	5278.40	-51.63	NA	0.0069	NA	7.92	2.48	Pass
NVNT	ax40	5230	Ant1	5278.4-26000	19323.50	-44.66	NA	0.0342	NA	2.5	2.5	Pass

Test Graphs

Tx. Spurious NVNT a 5180MHz Ant1 @ 30MHz-1000MHz

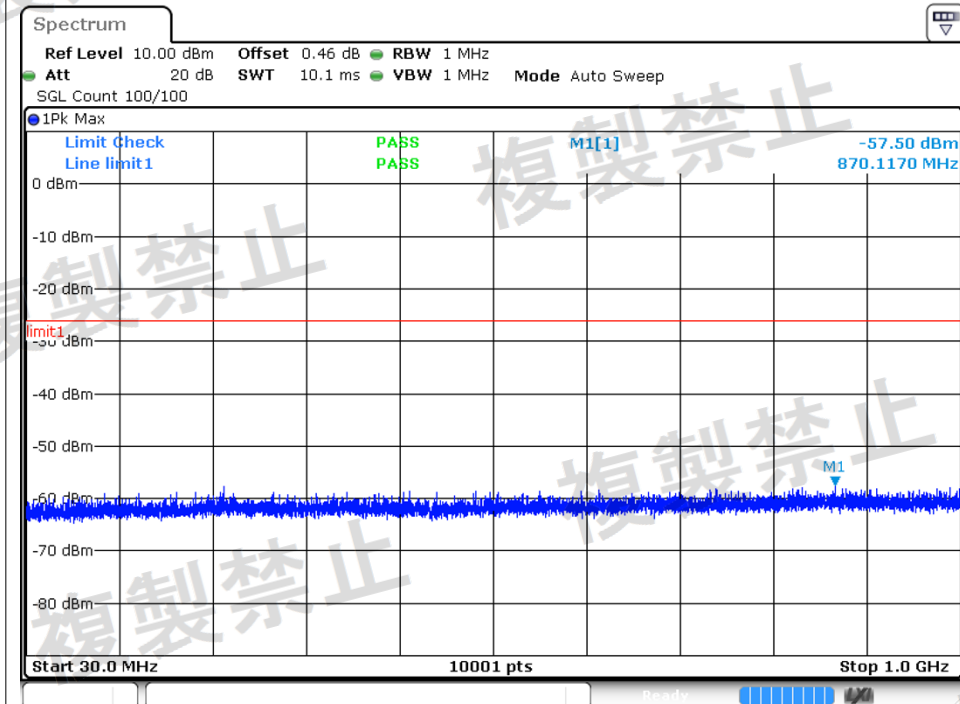

Tx. Spurious NVNT a 5180MHz Ant1 @ 1000MHz-5142MHz

