






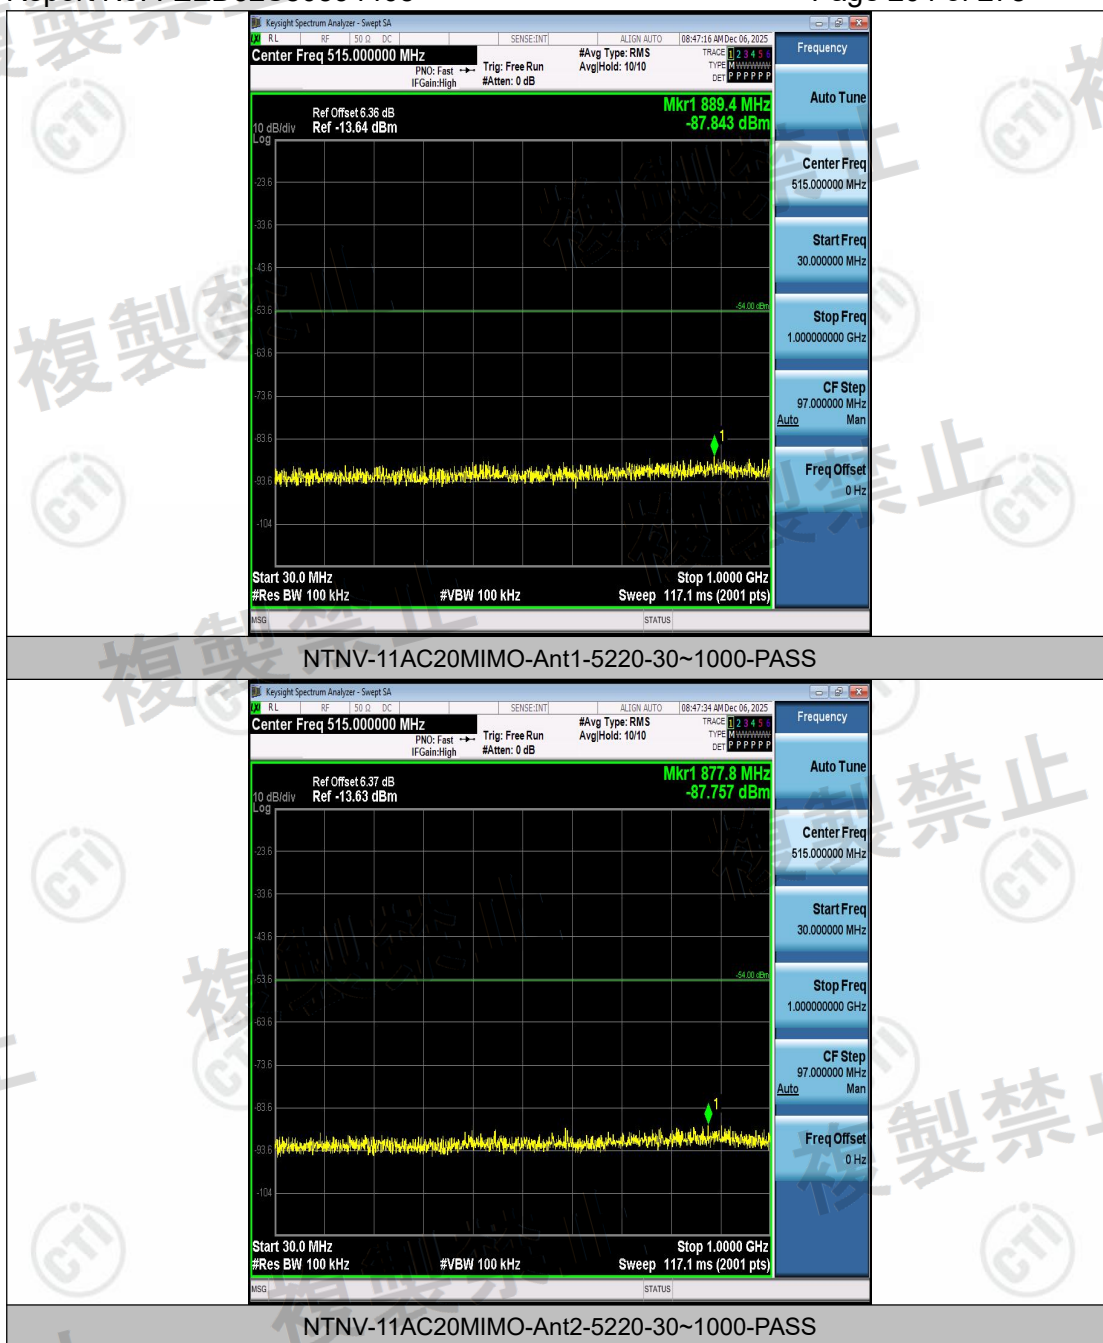


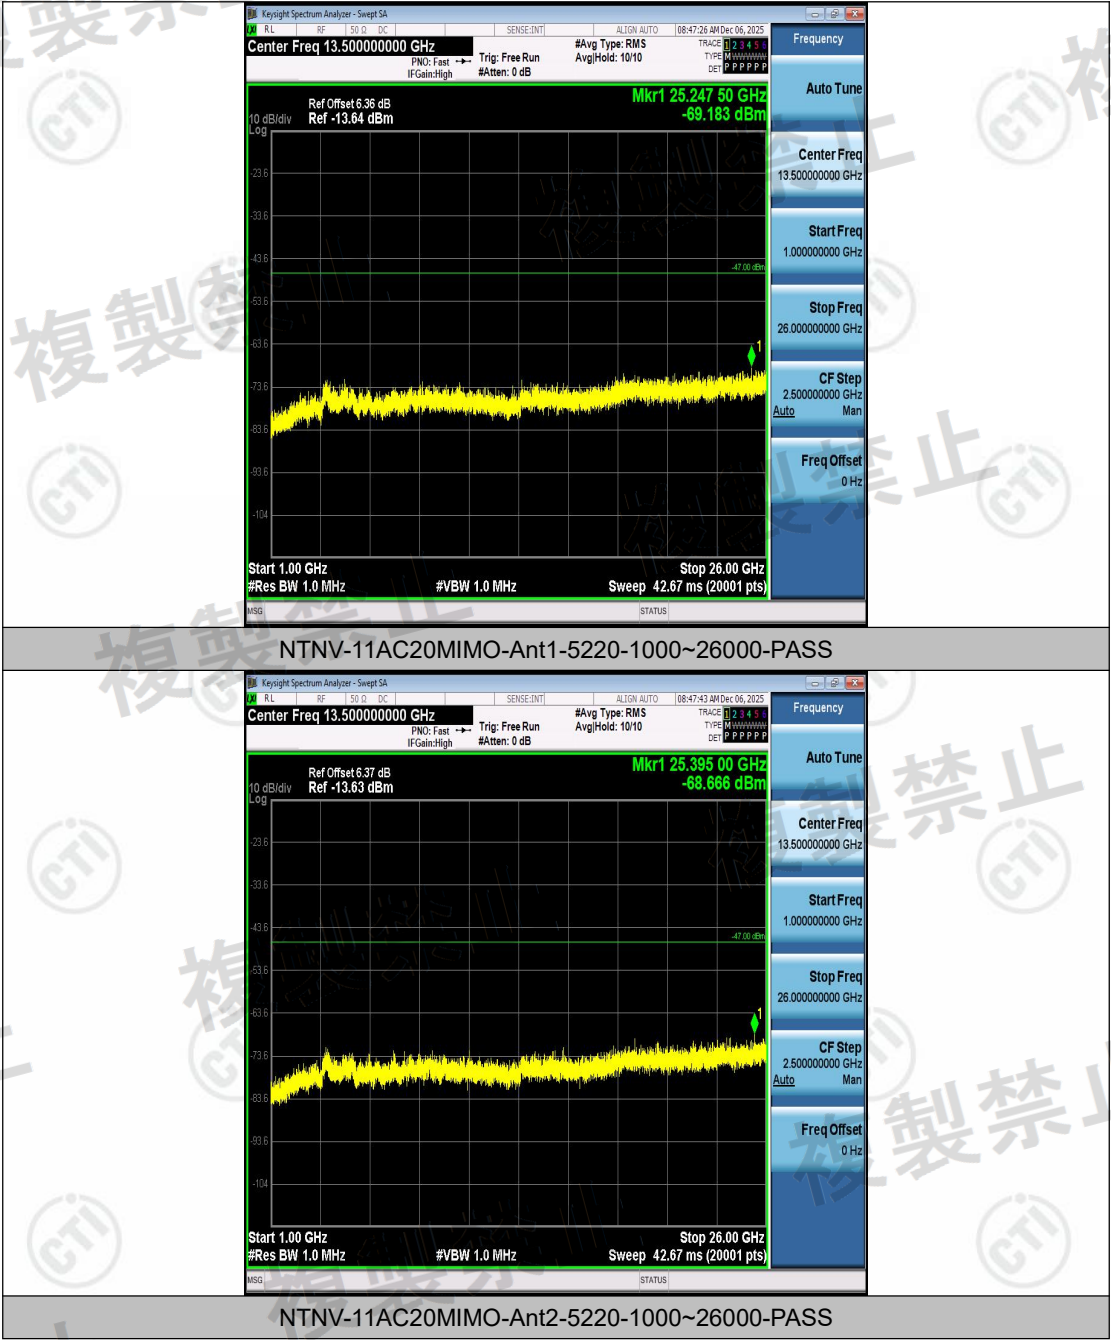


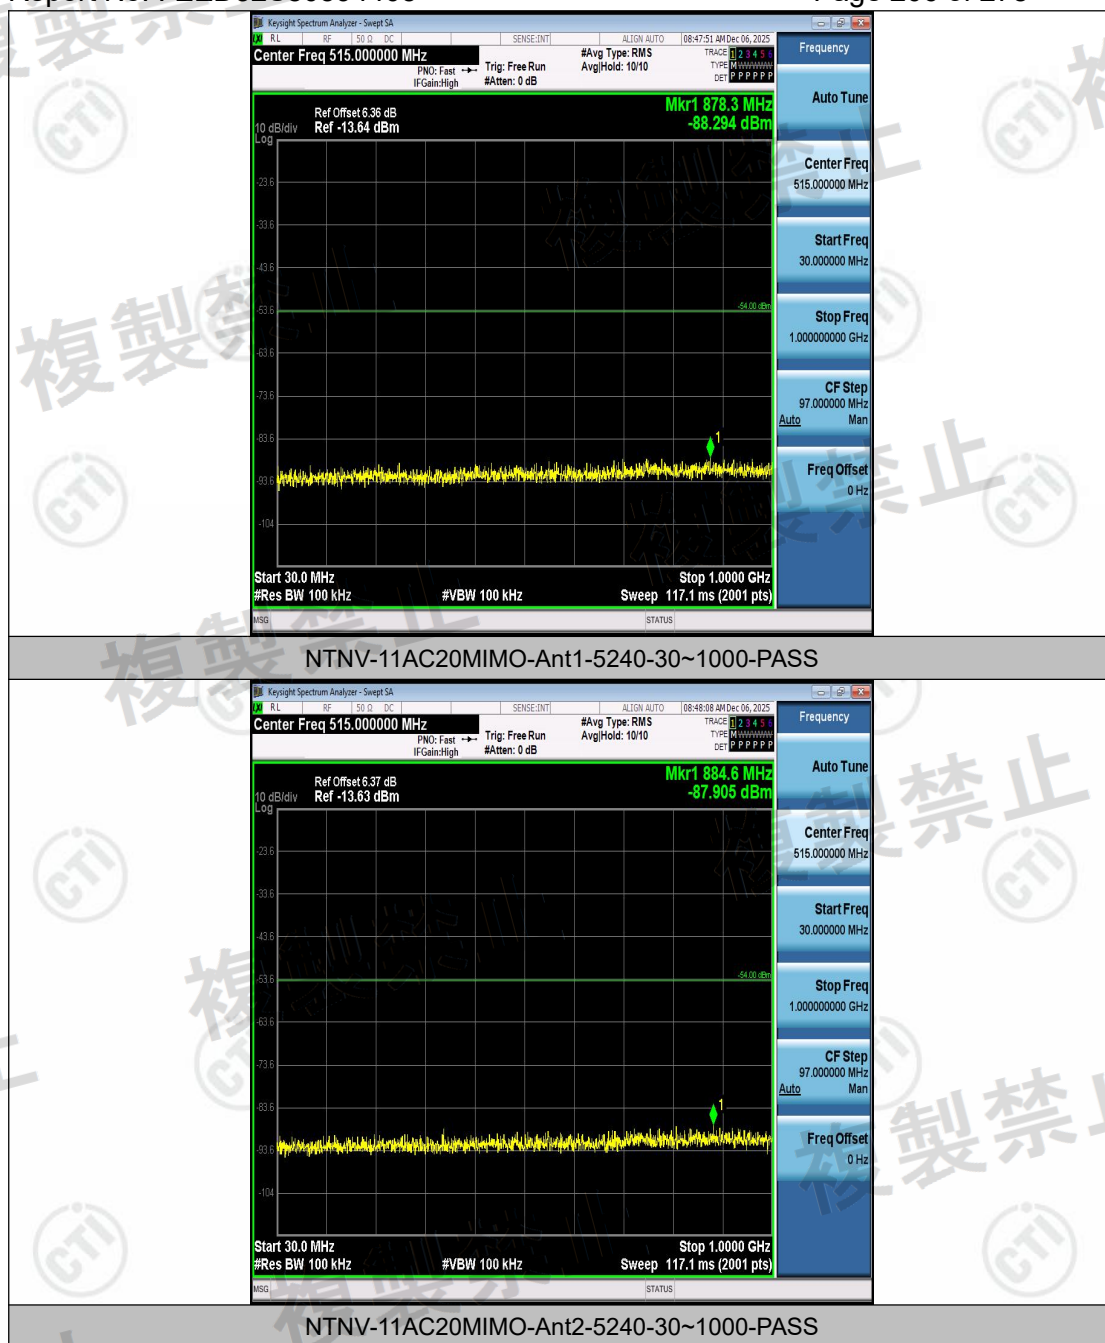


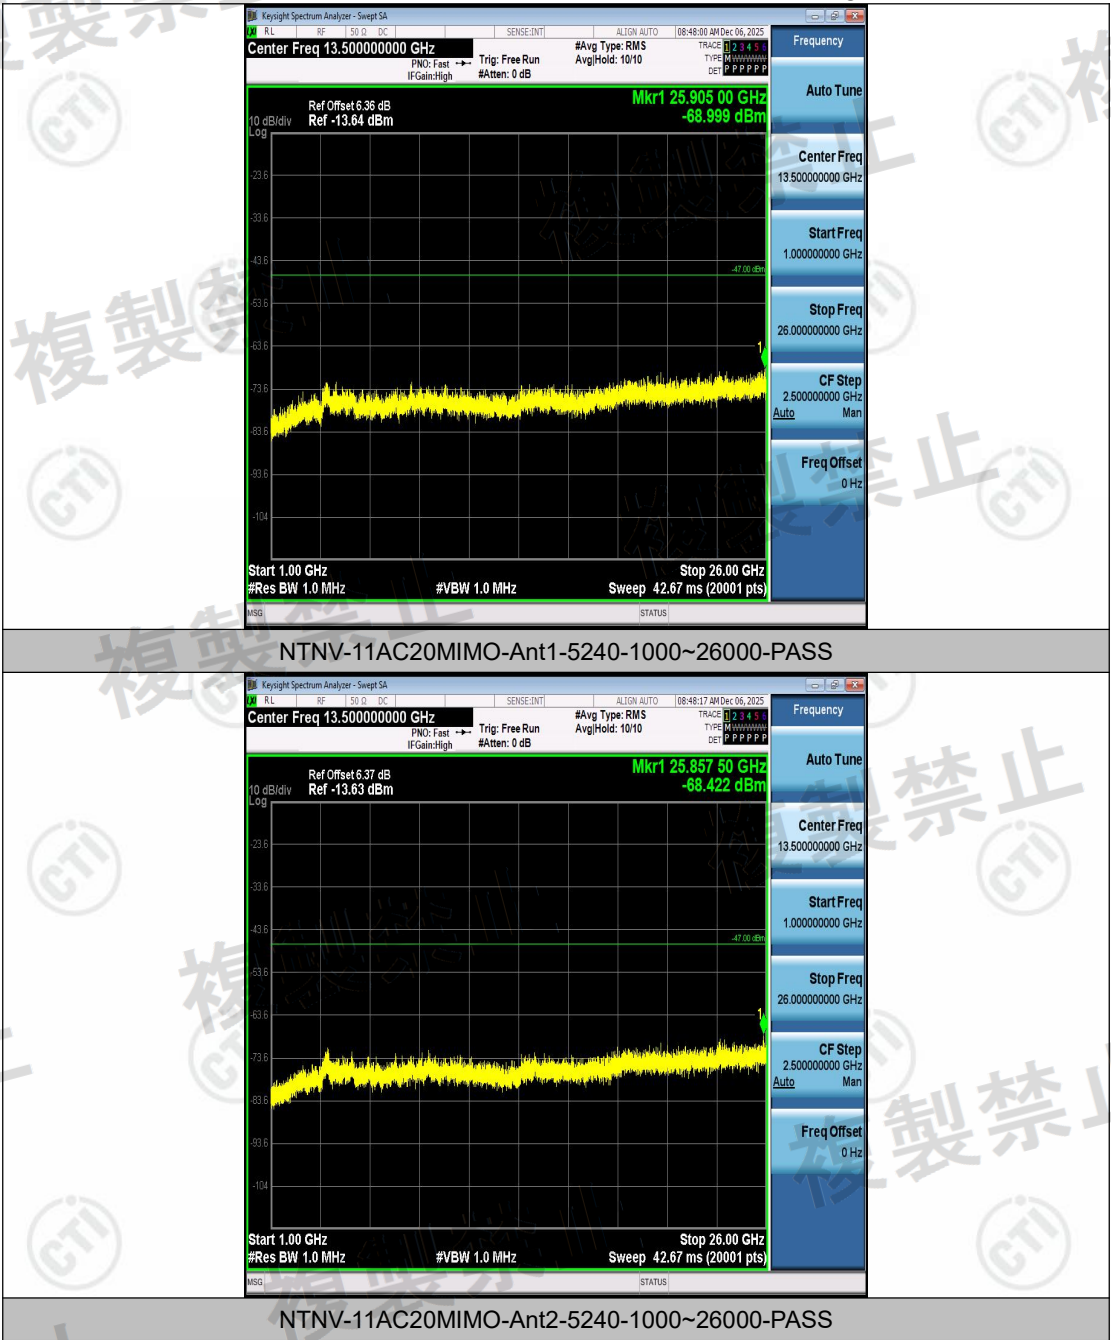


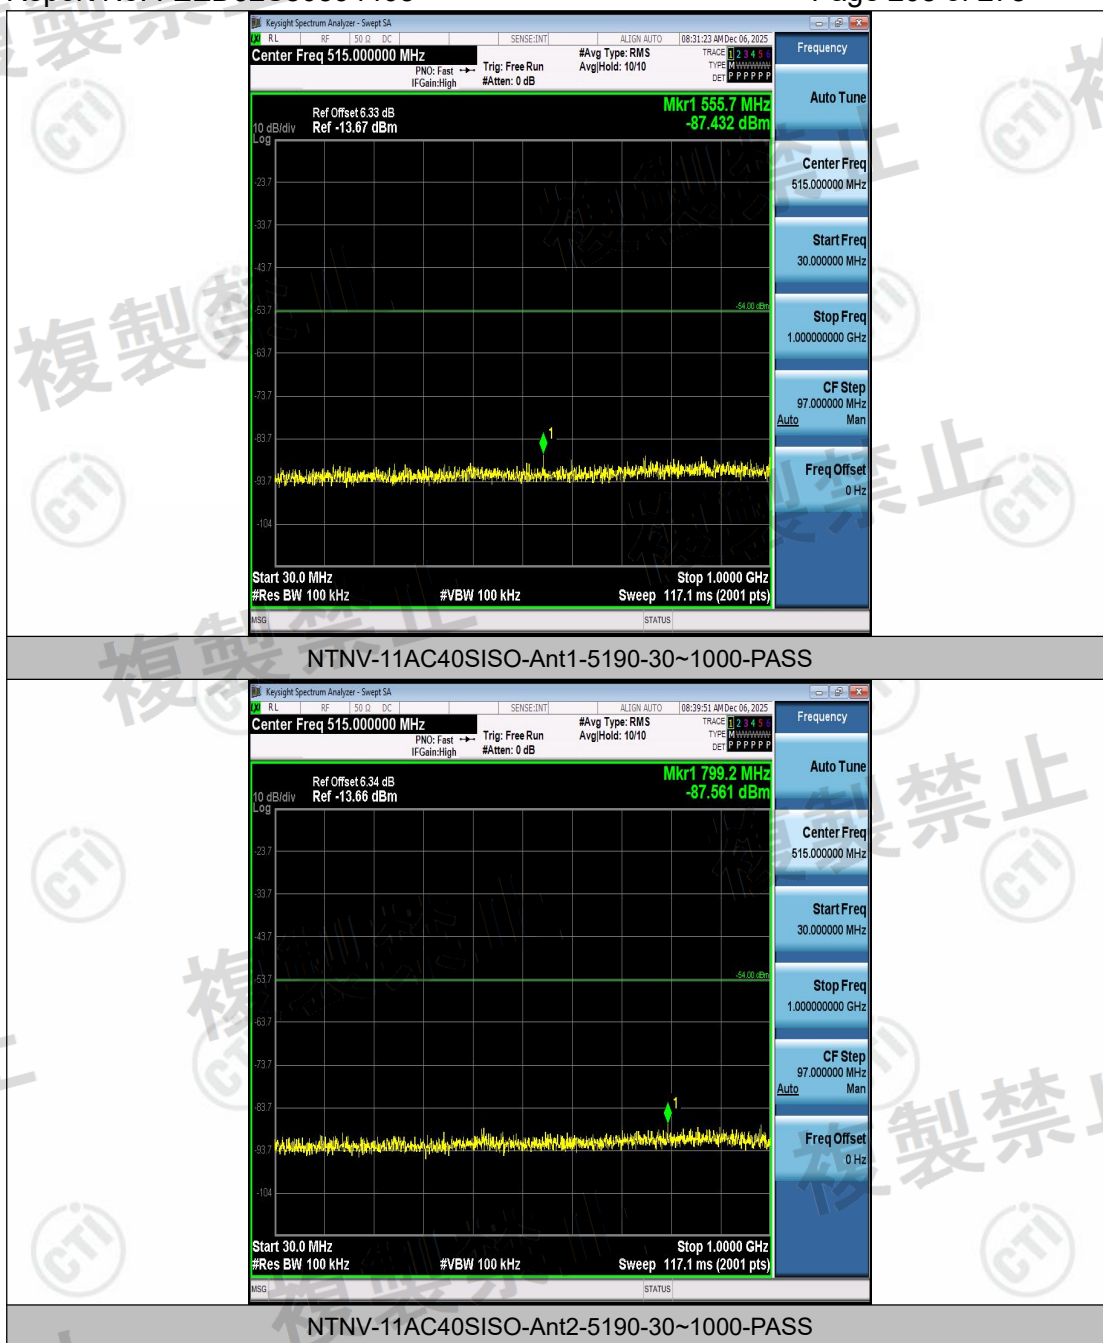


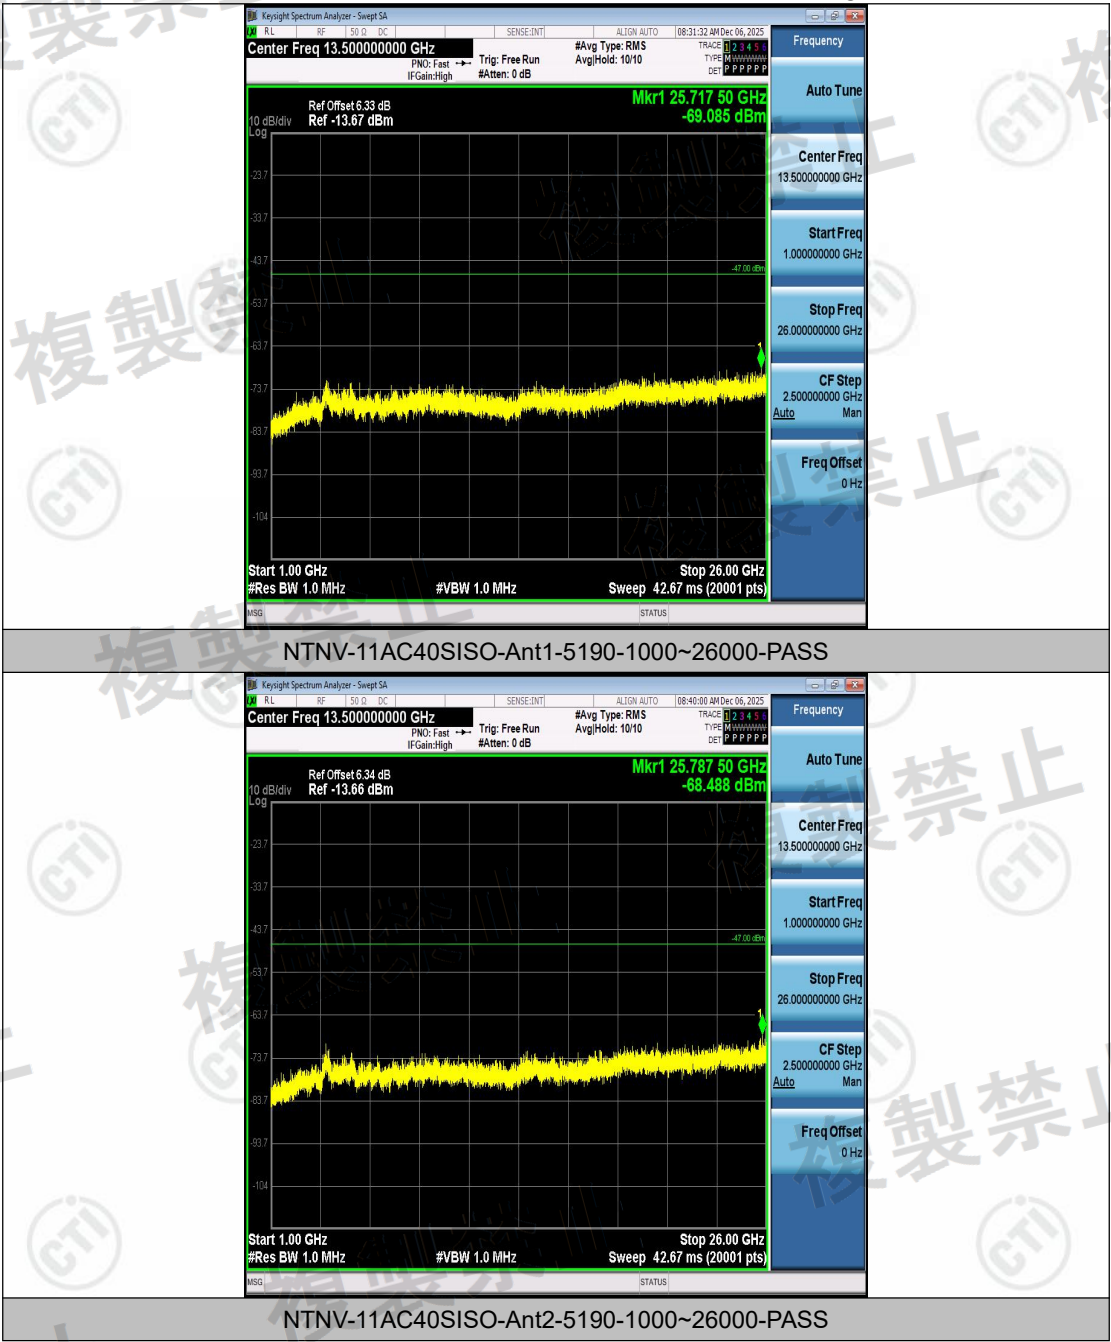


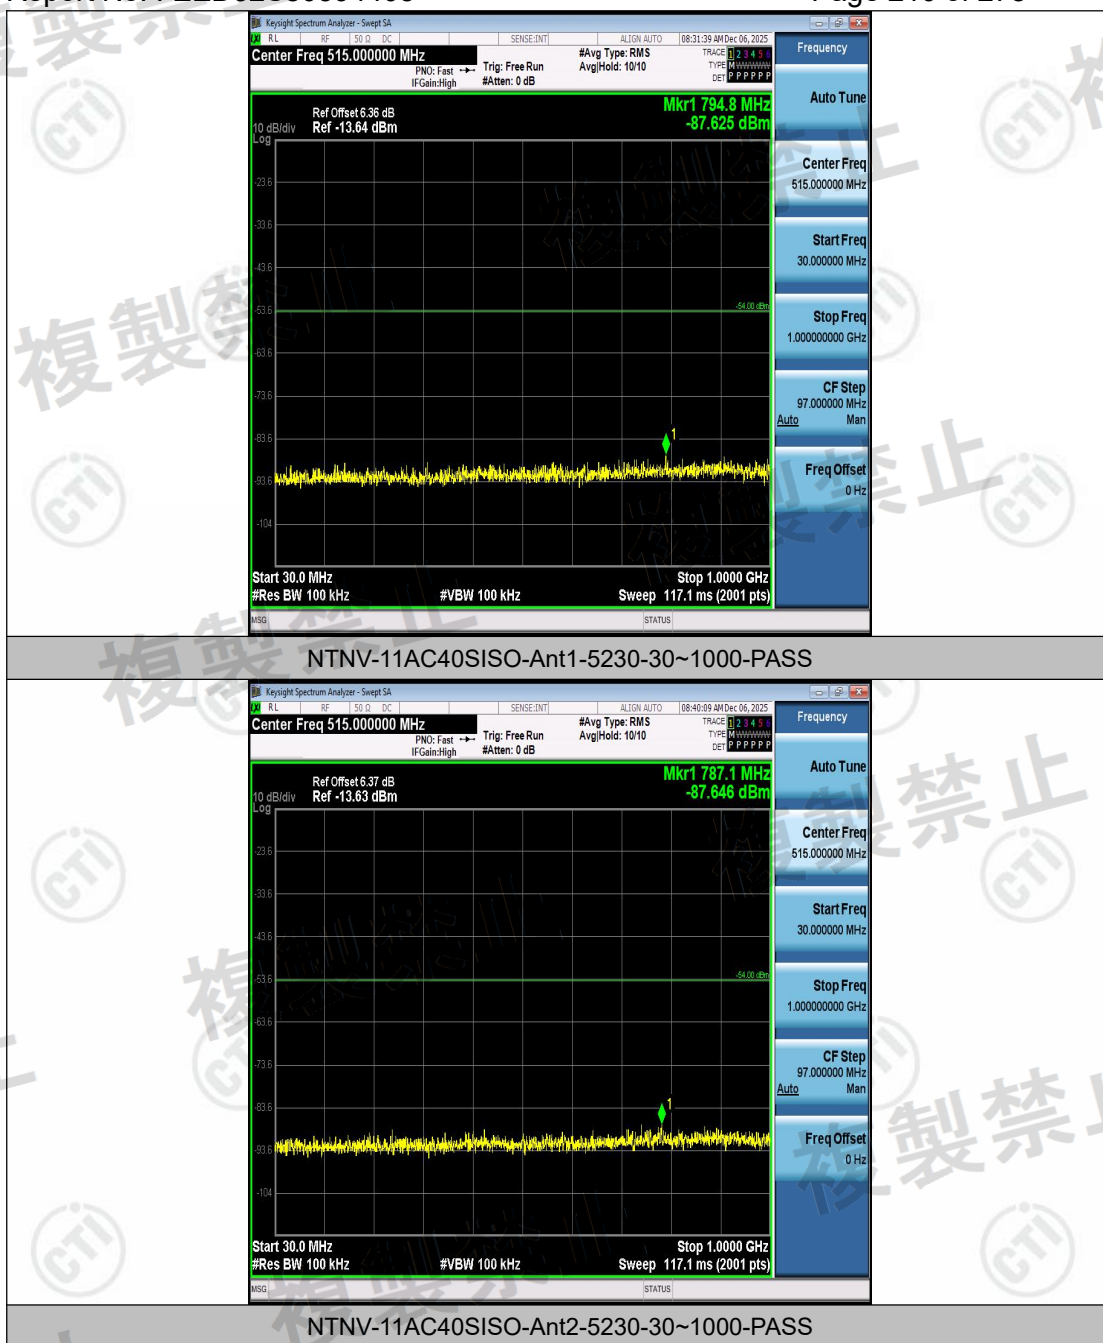


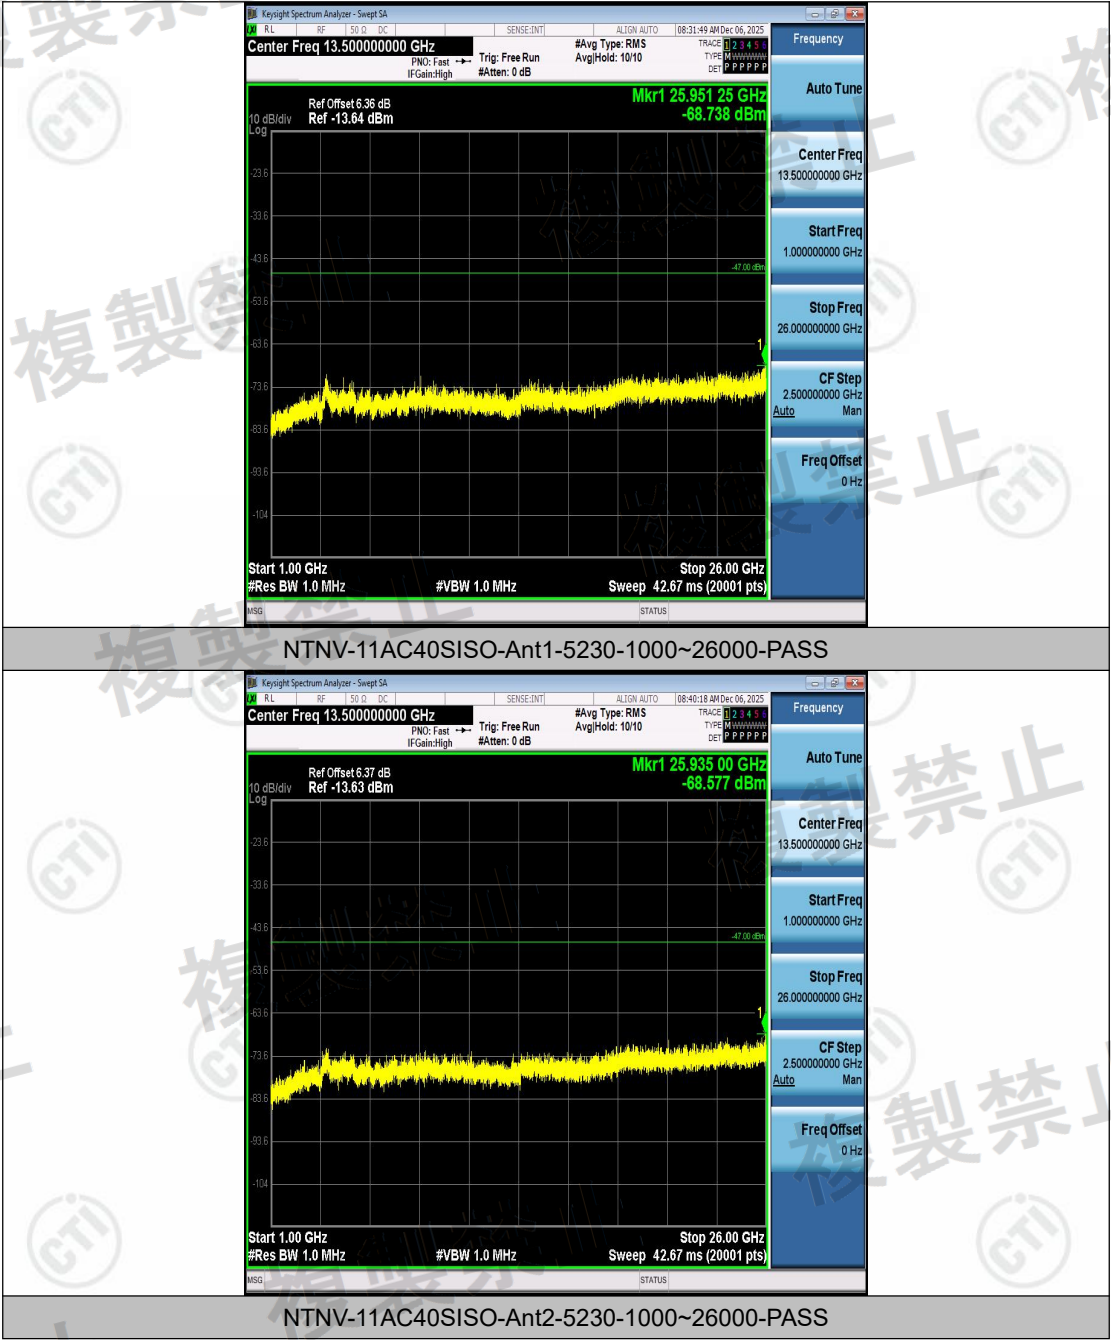


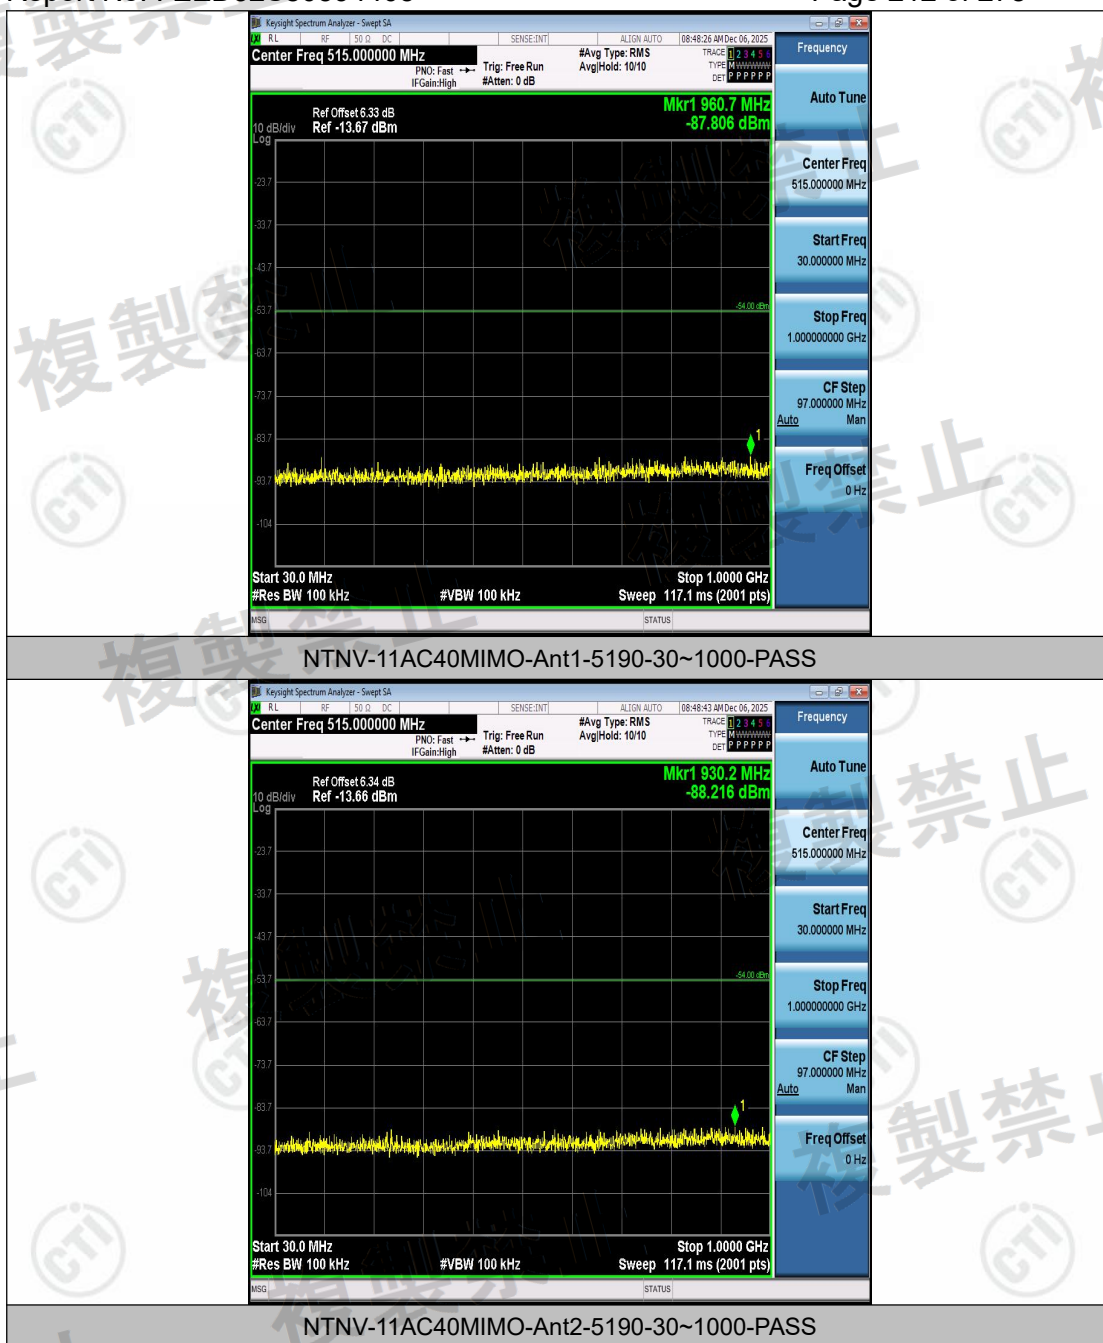


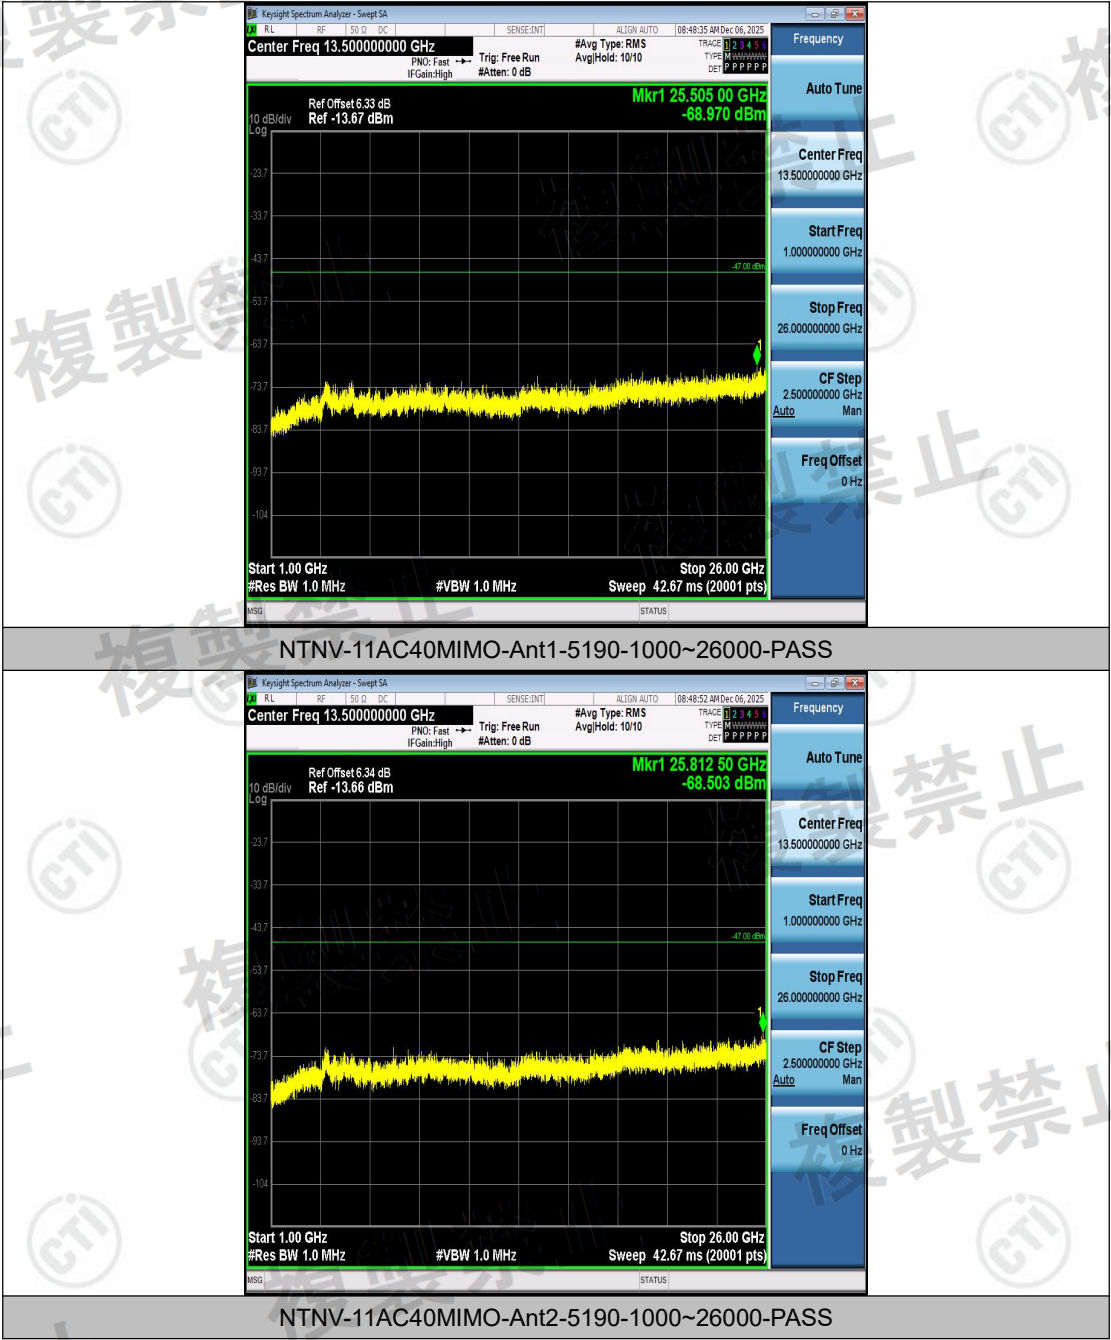


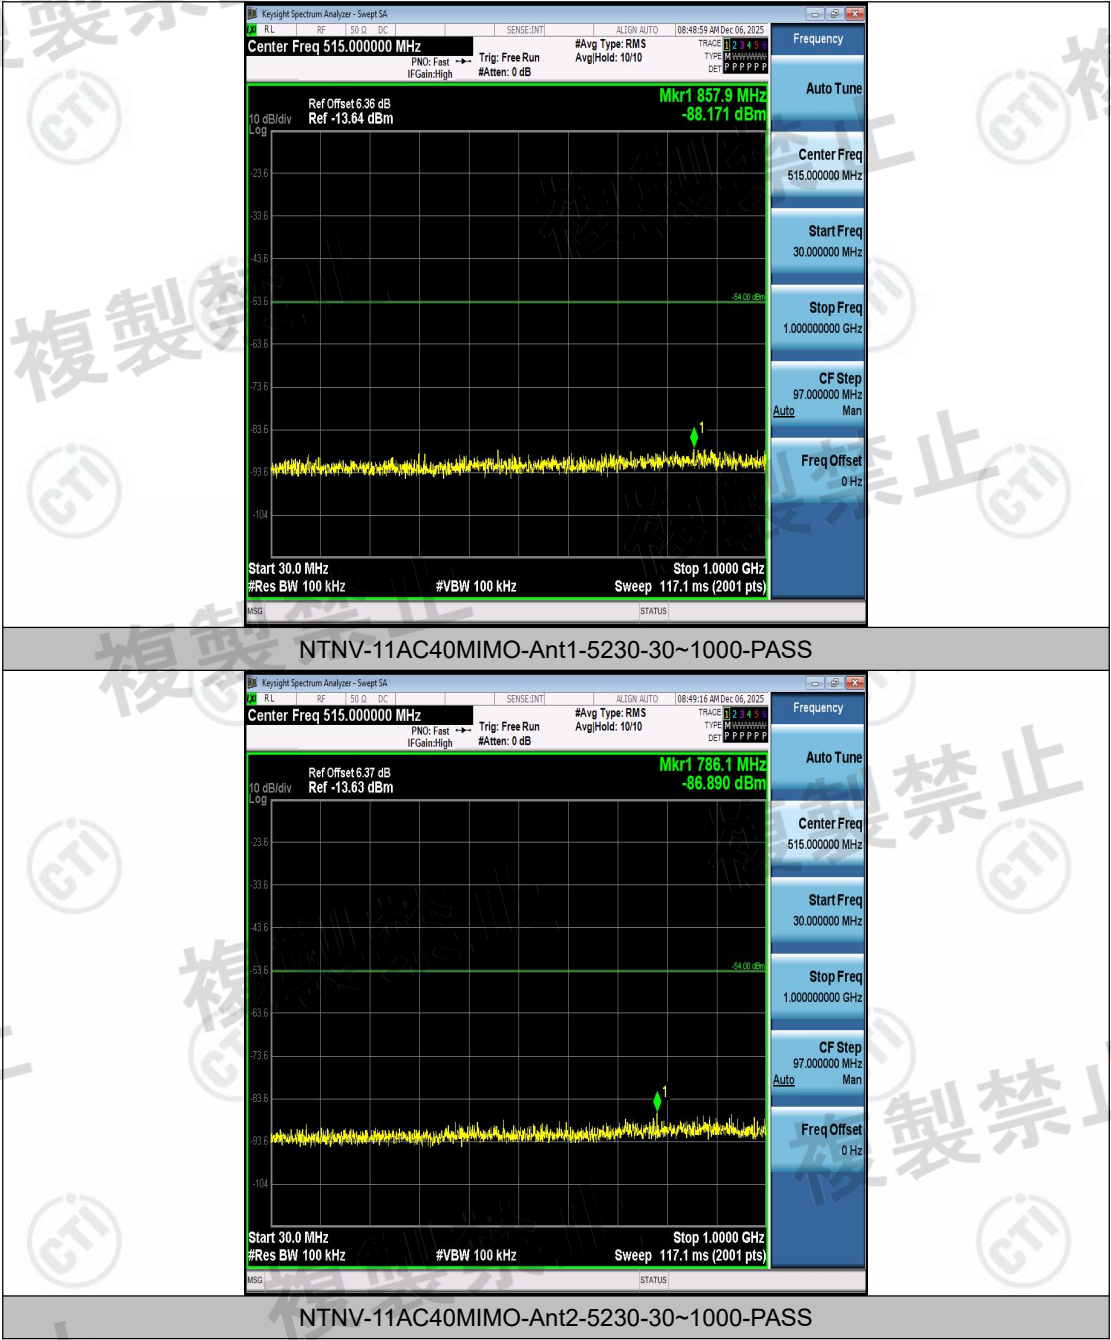


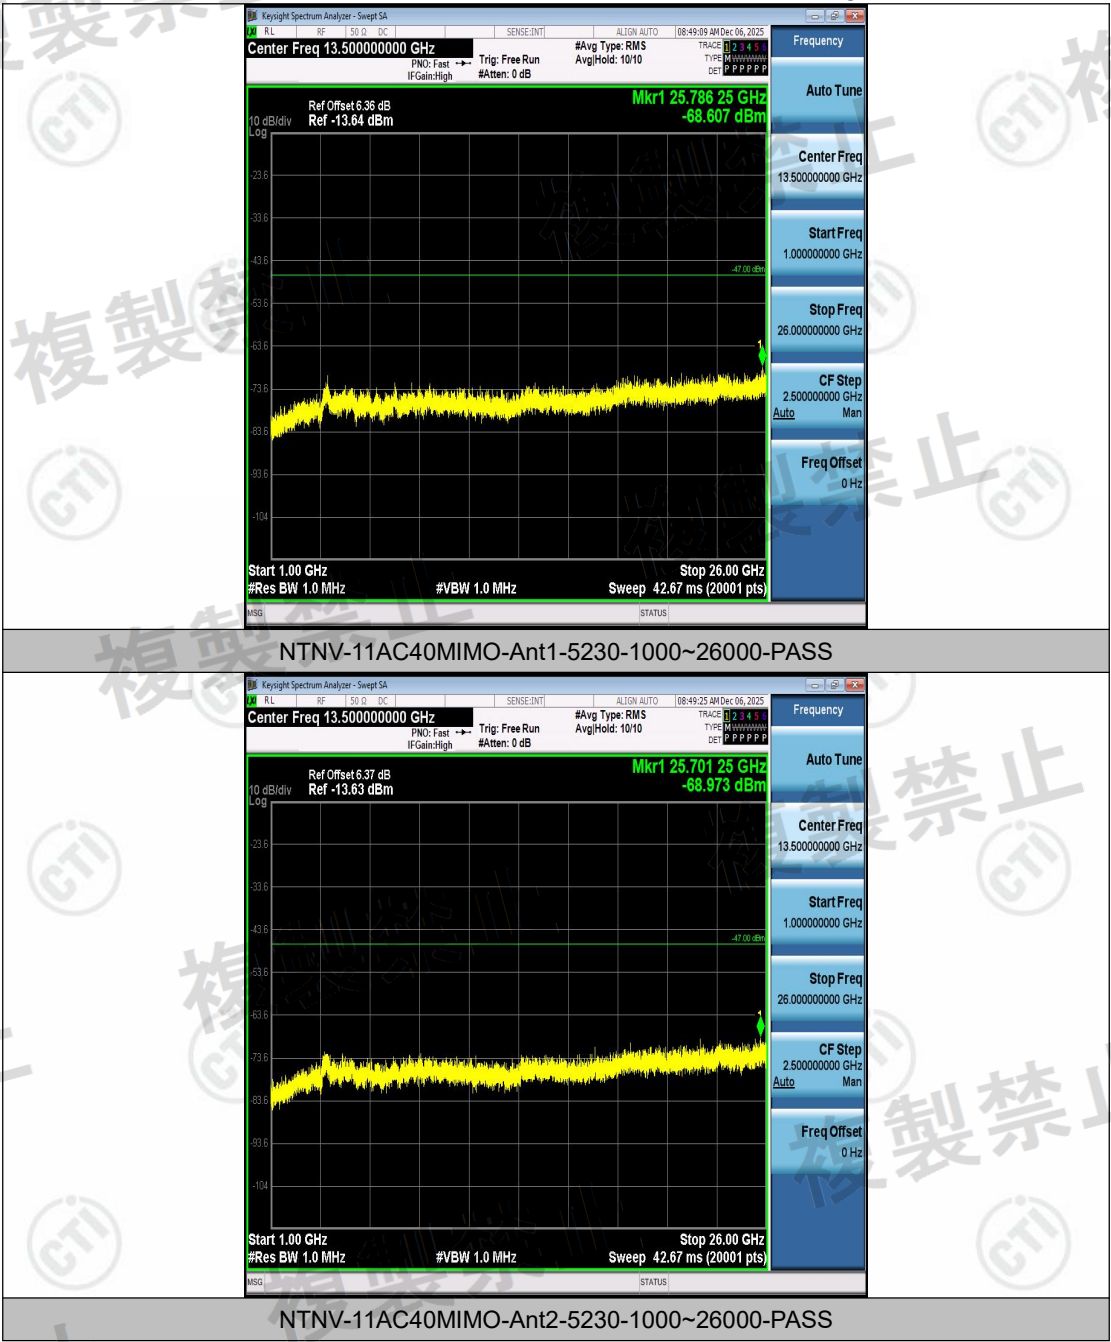


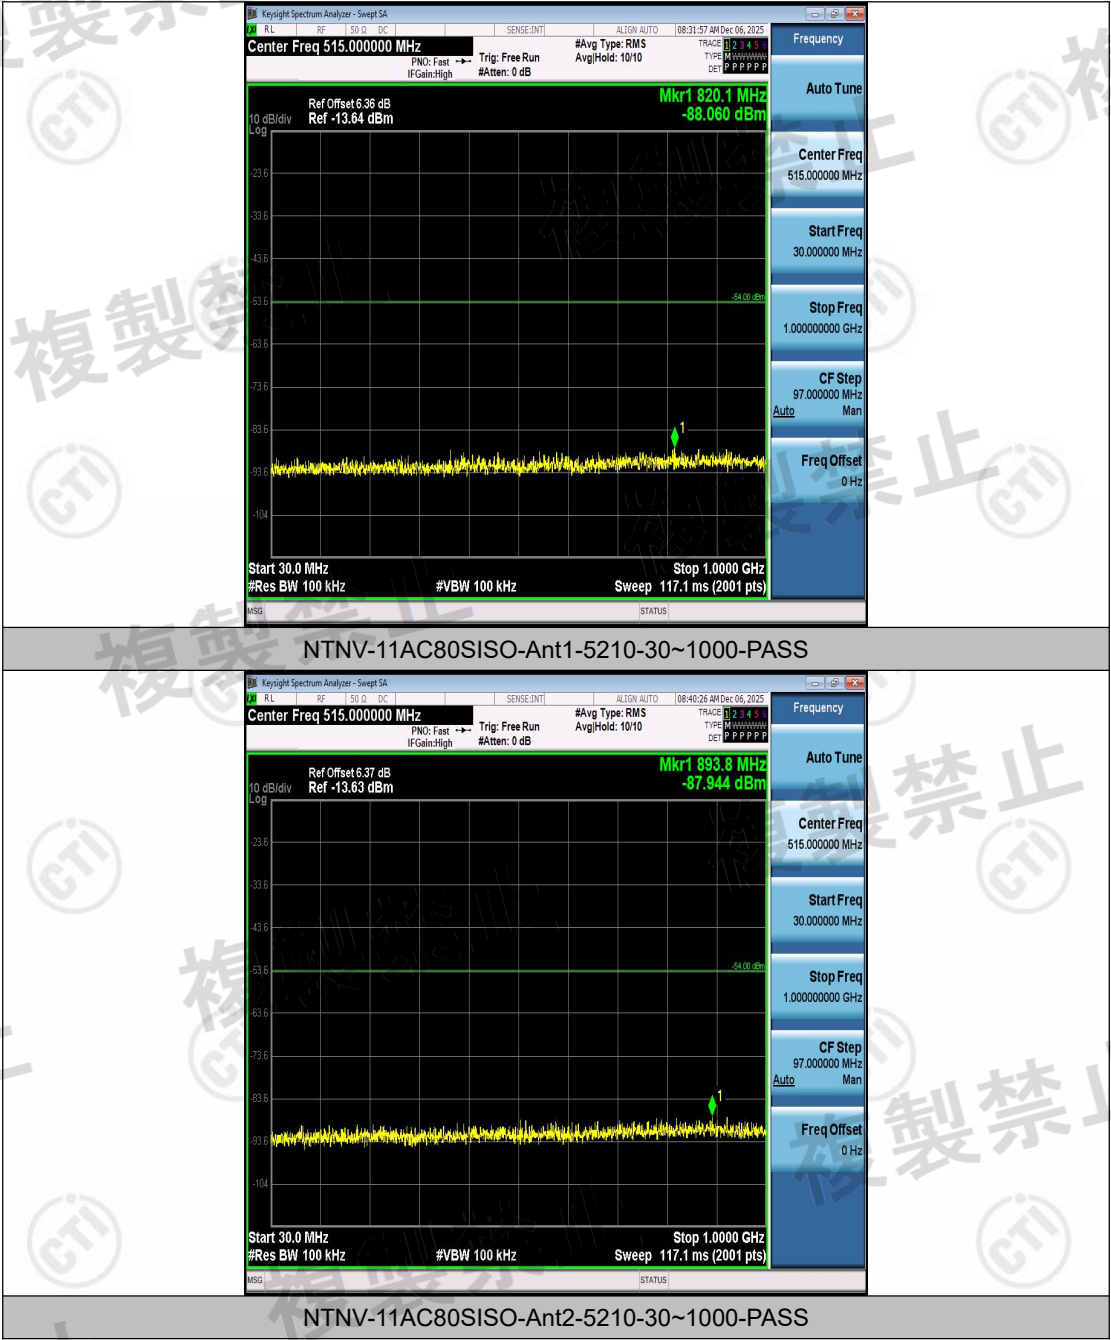


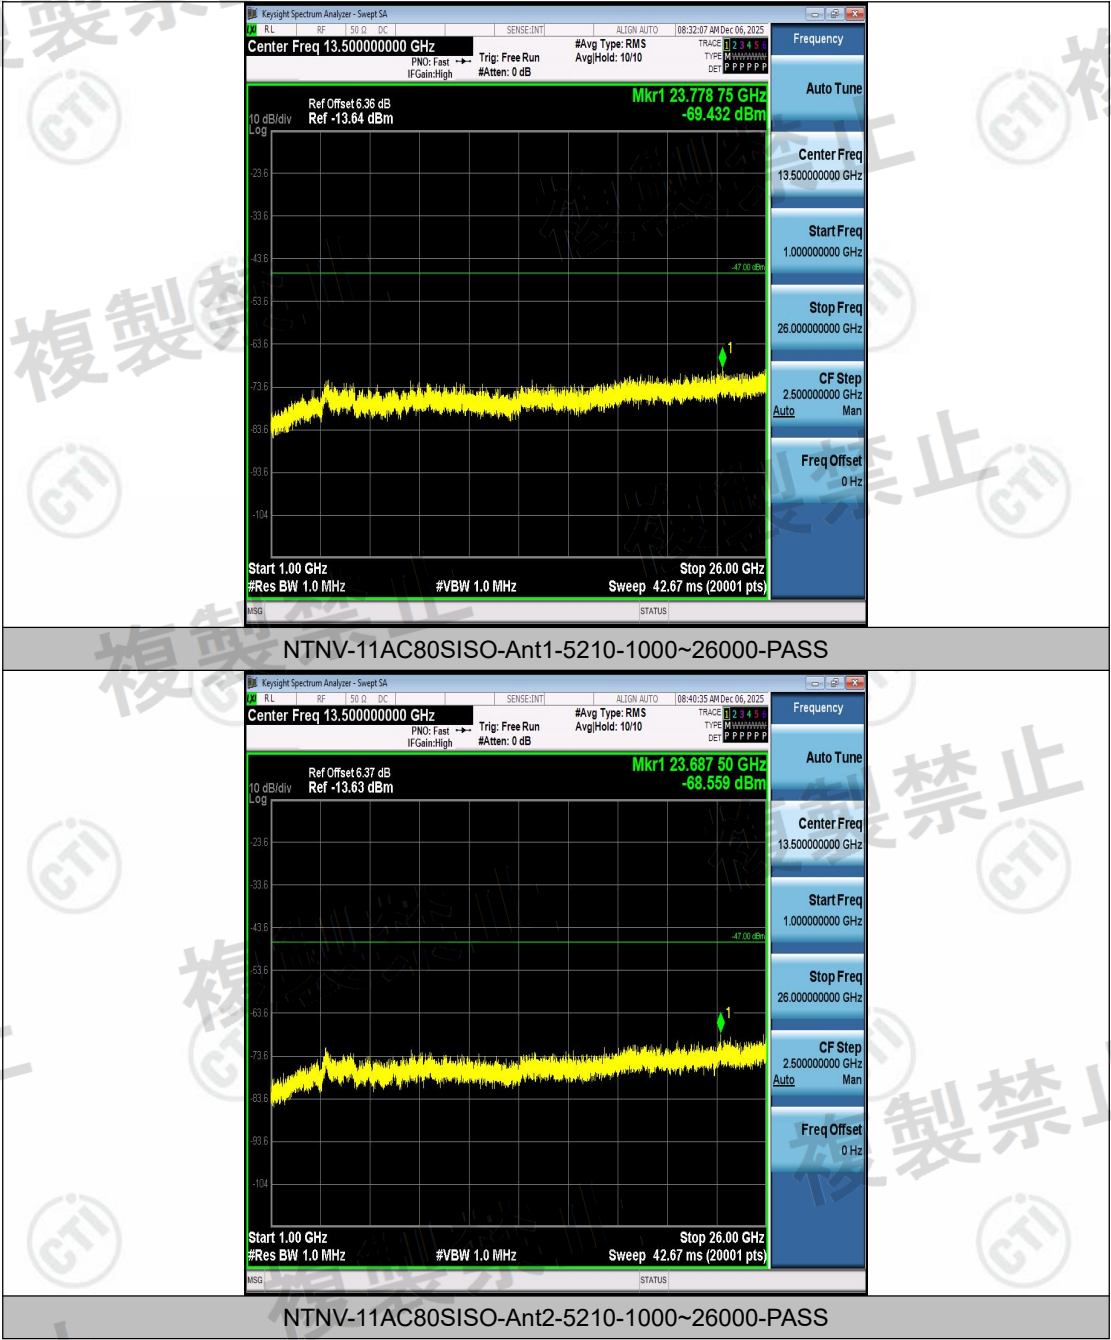


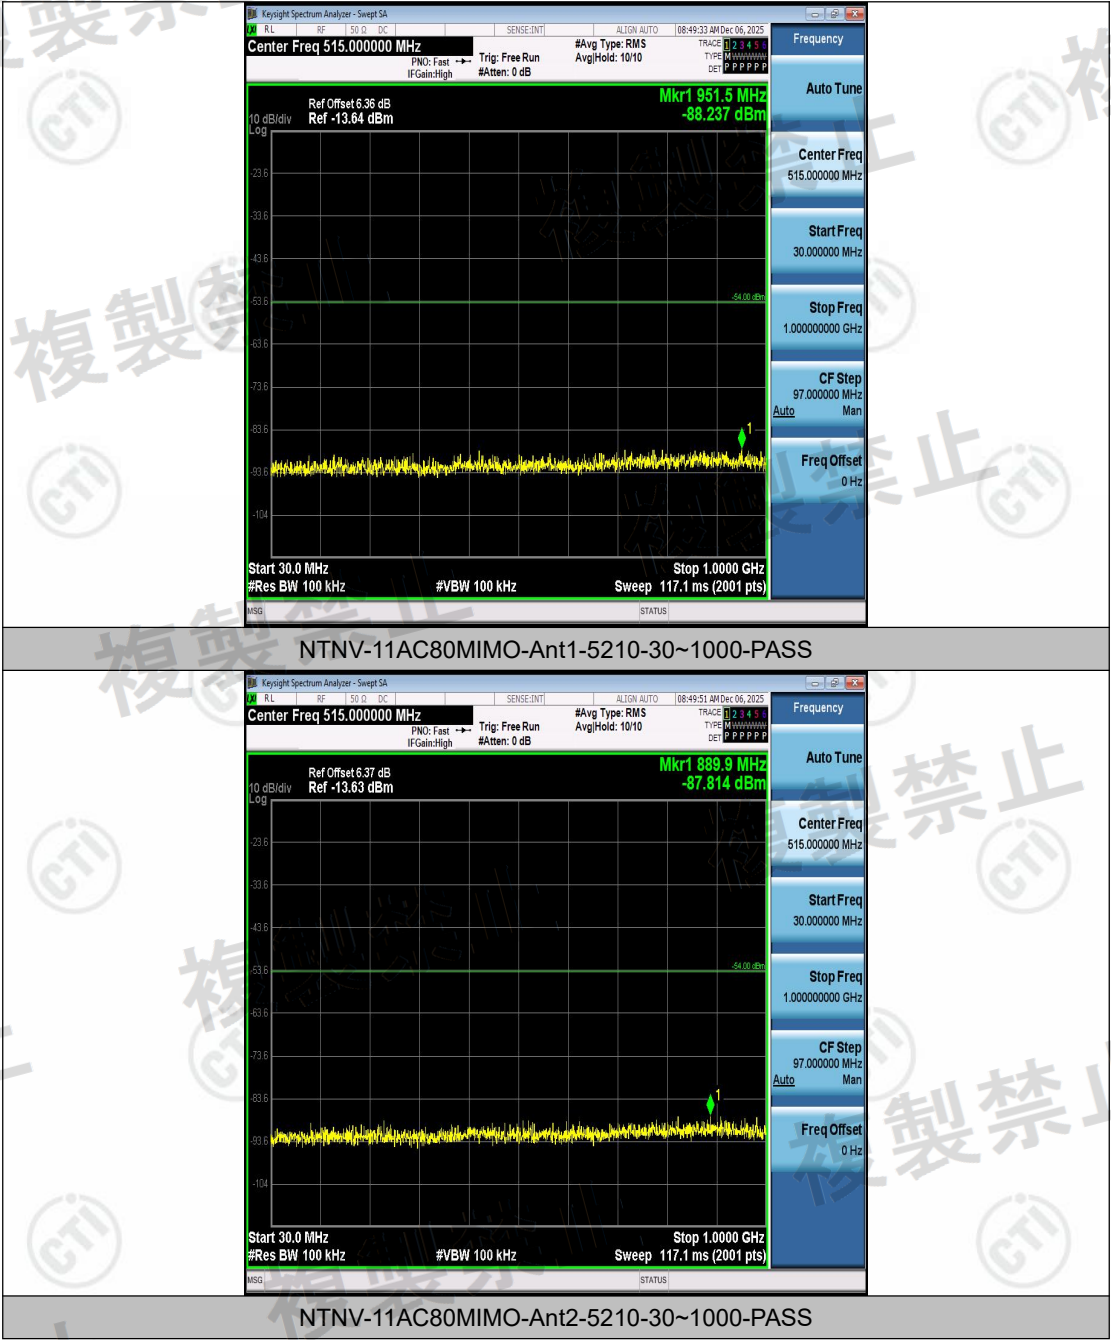


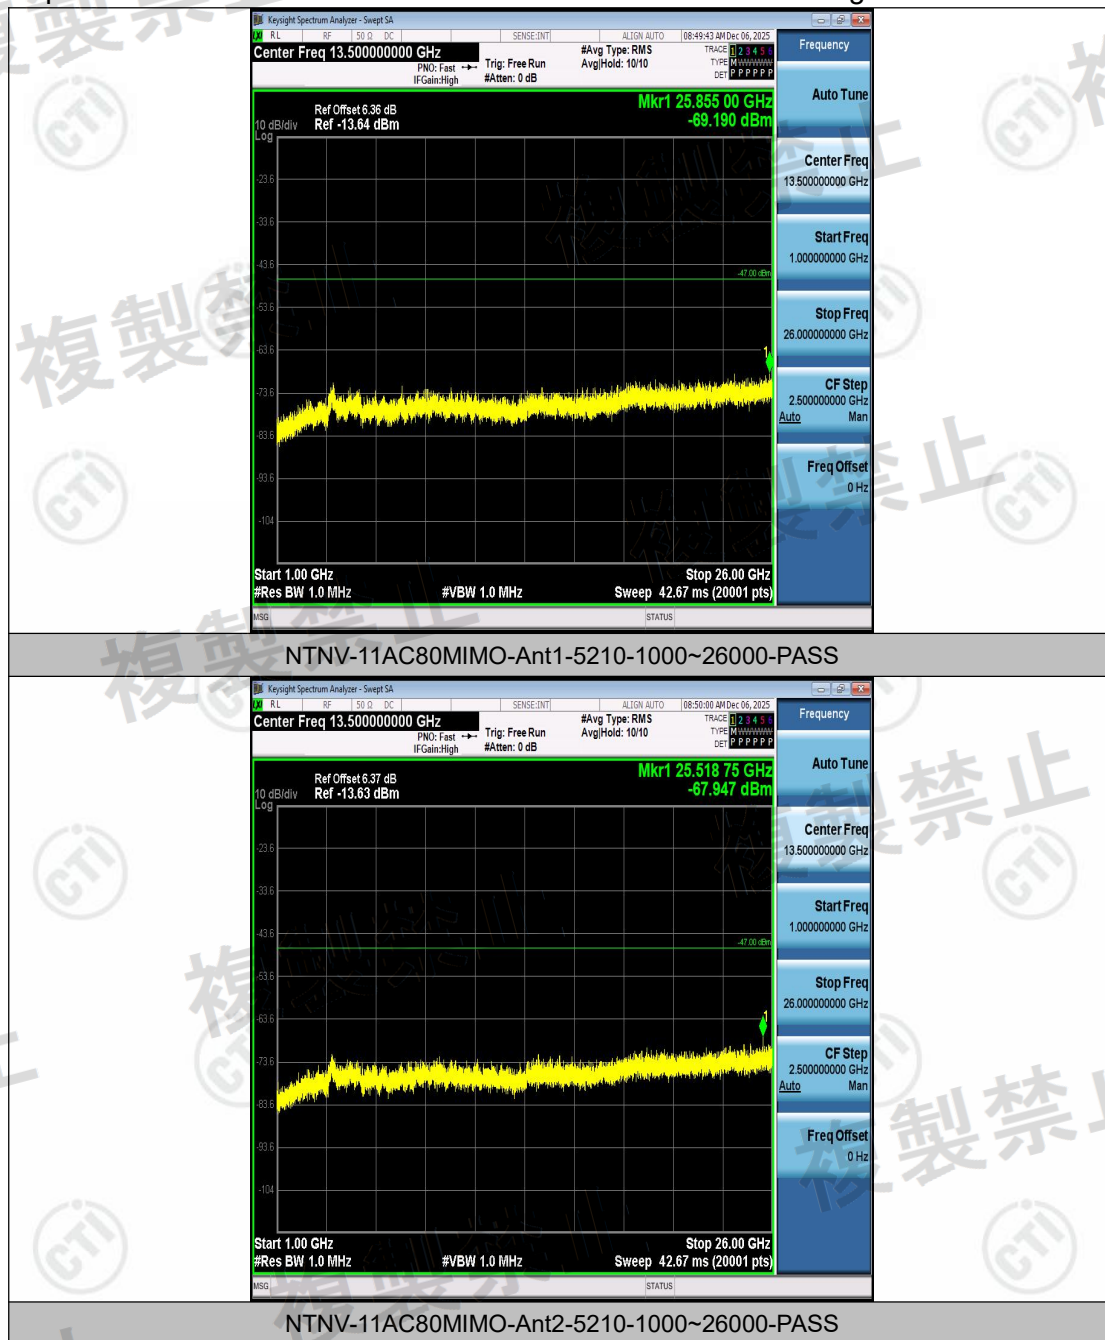


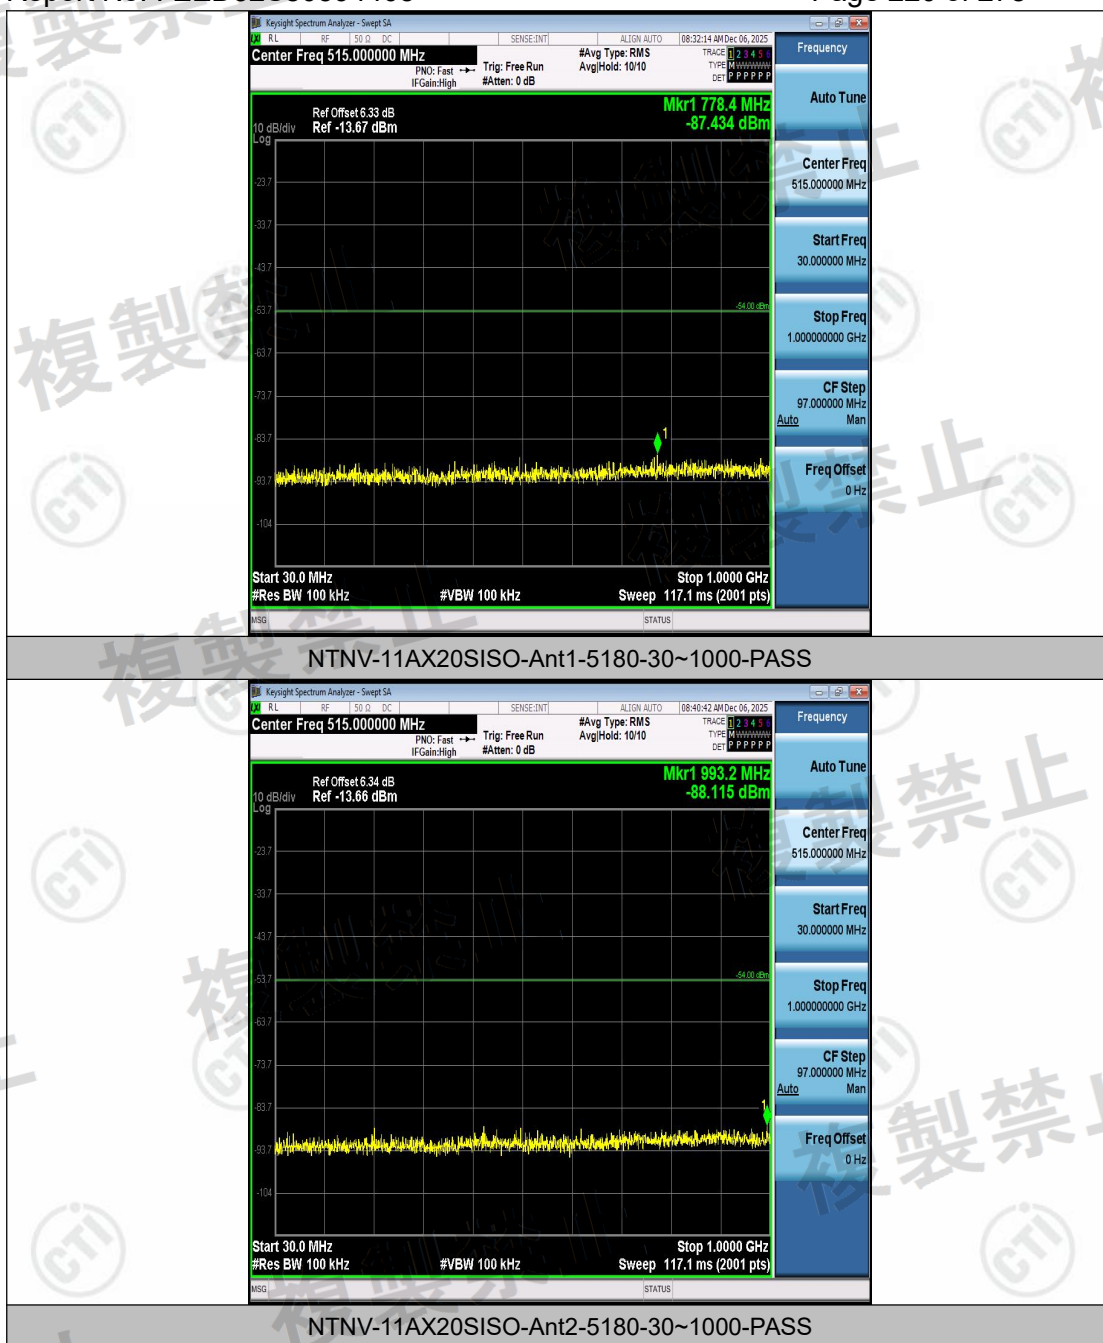


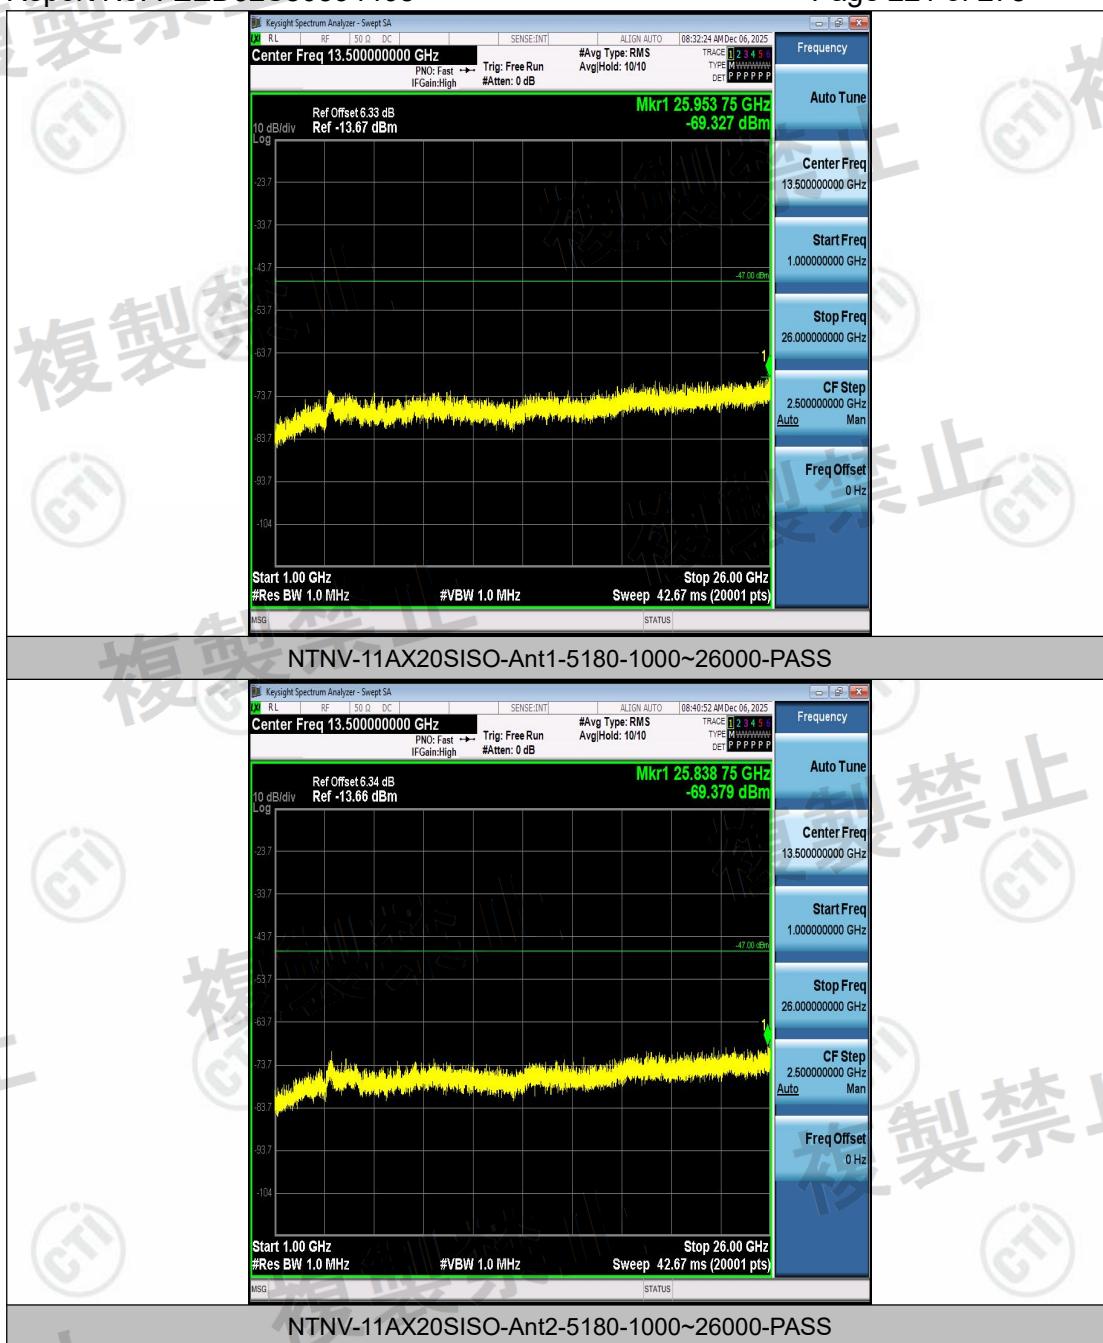


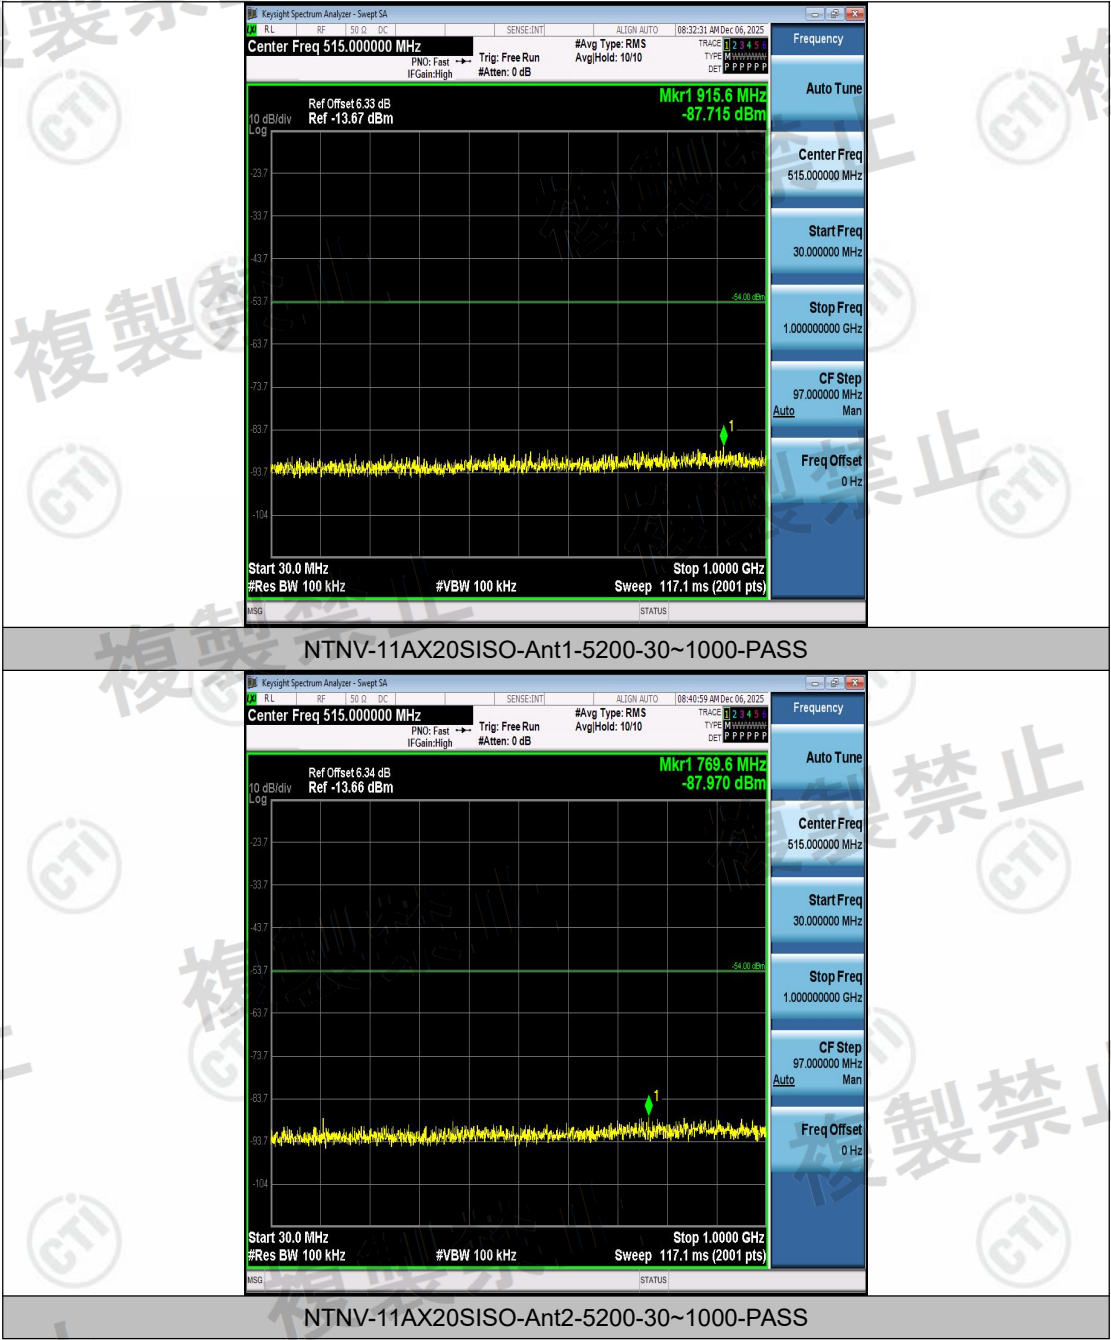


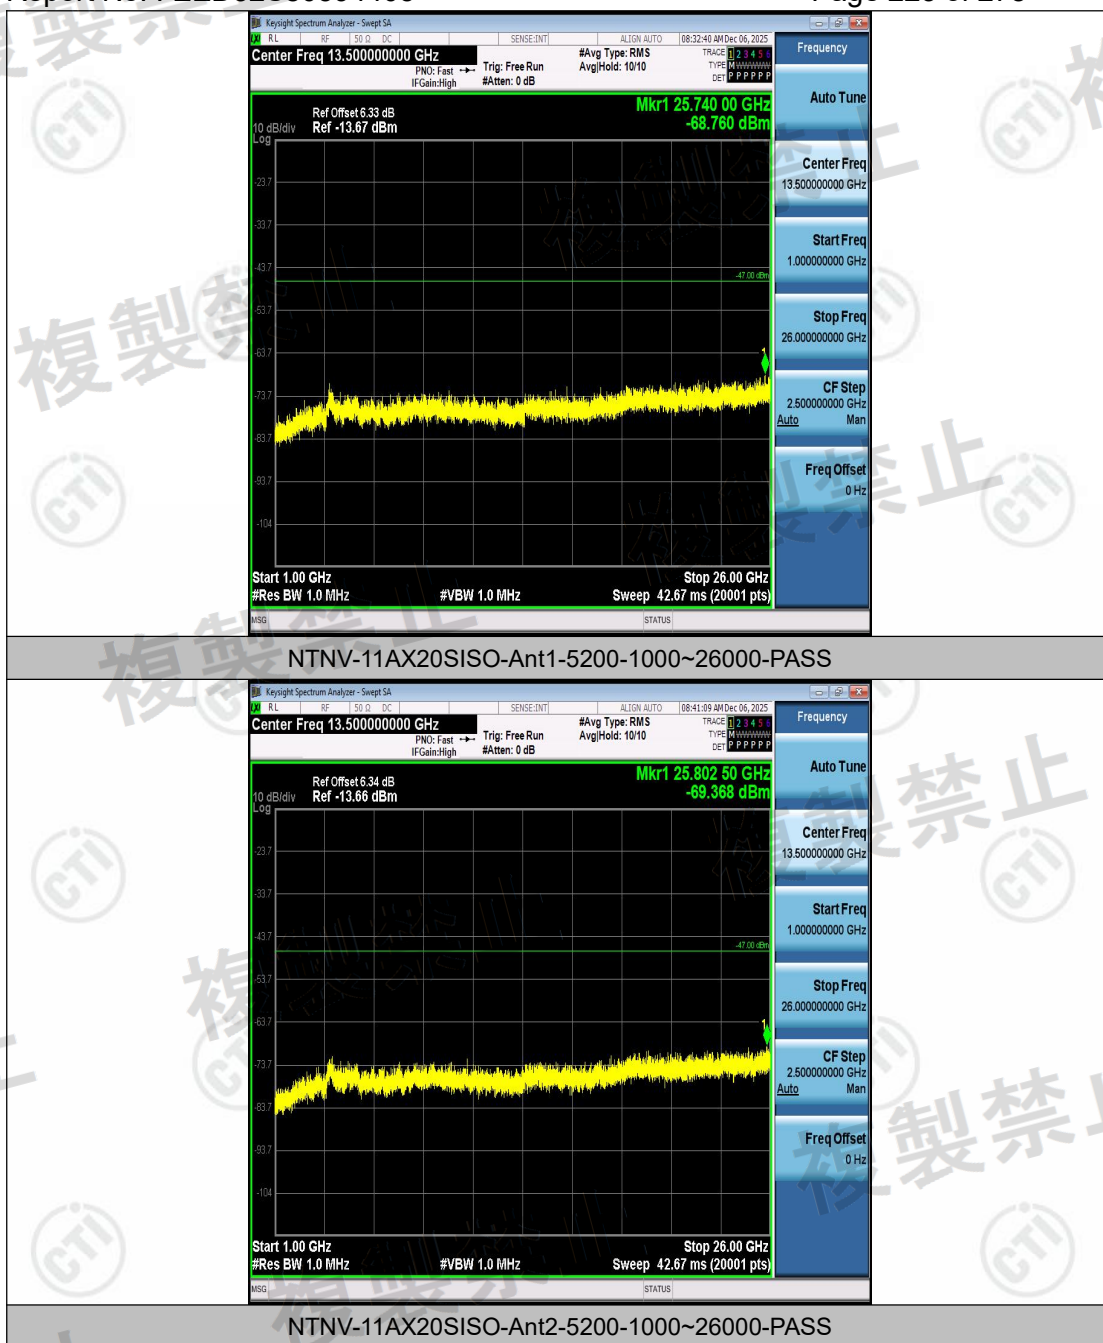


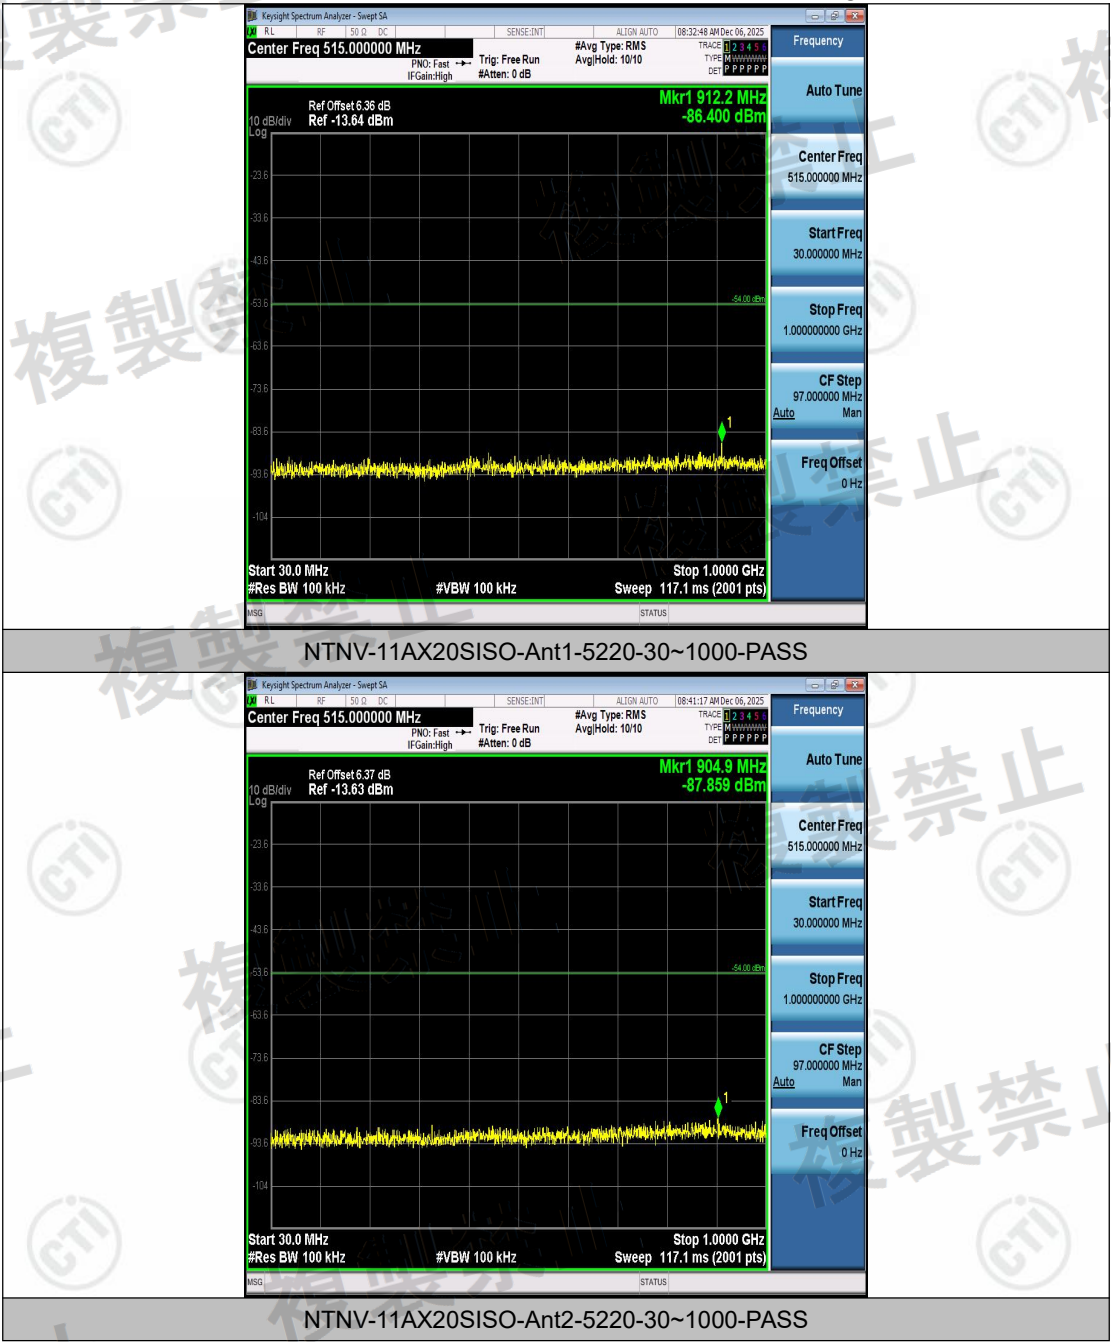


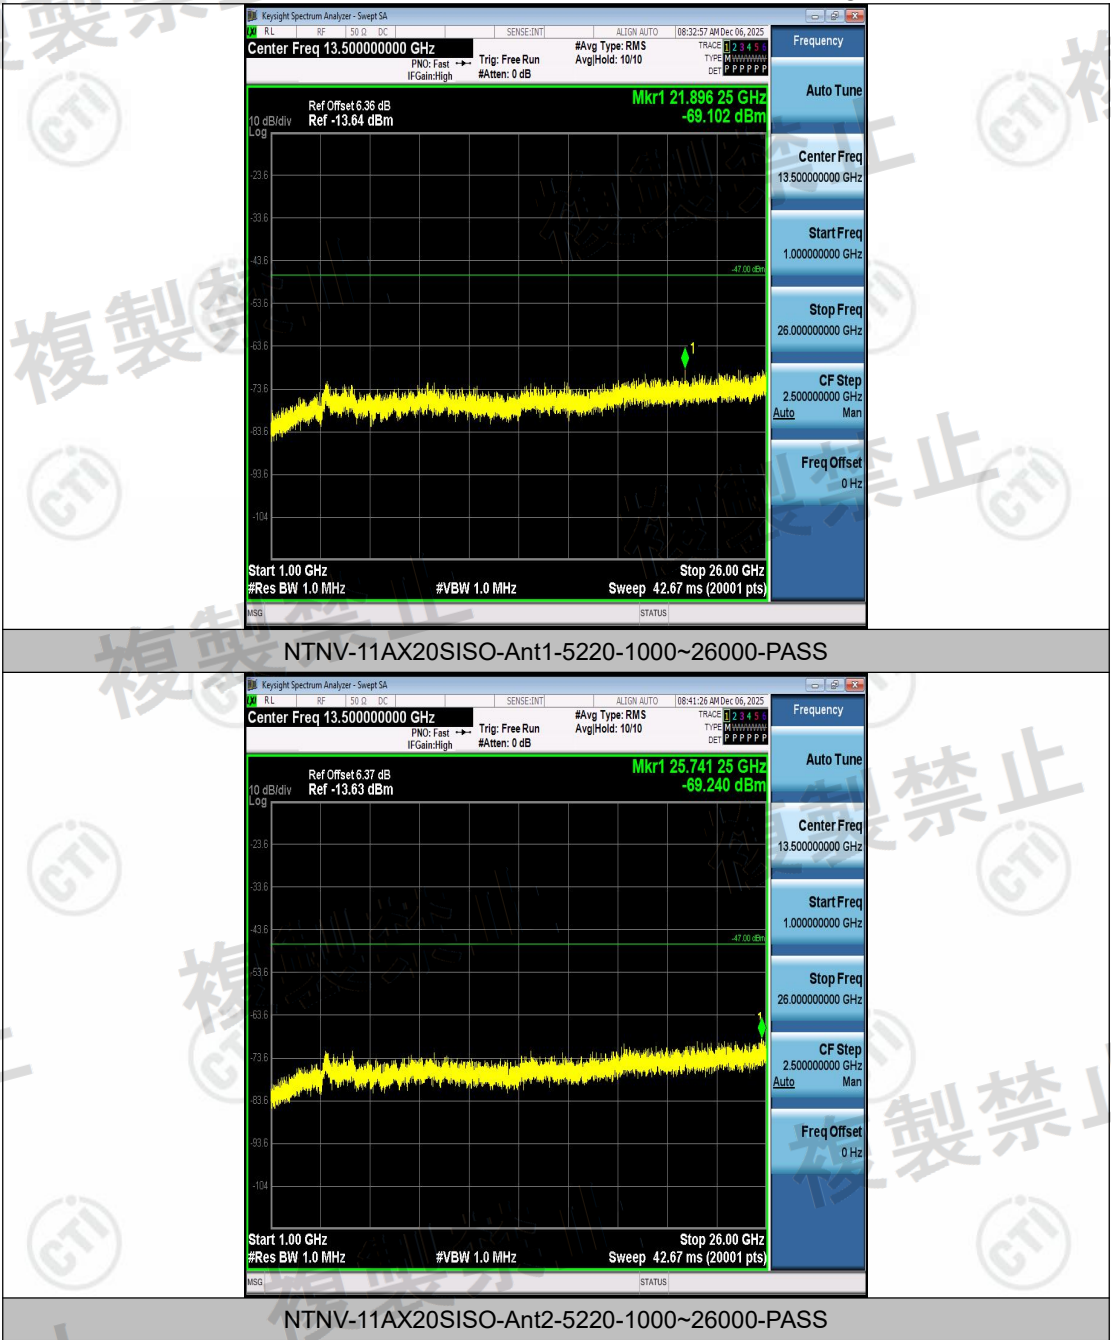


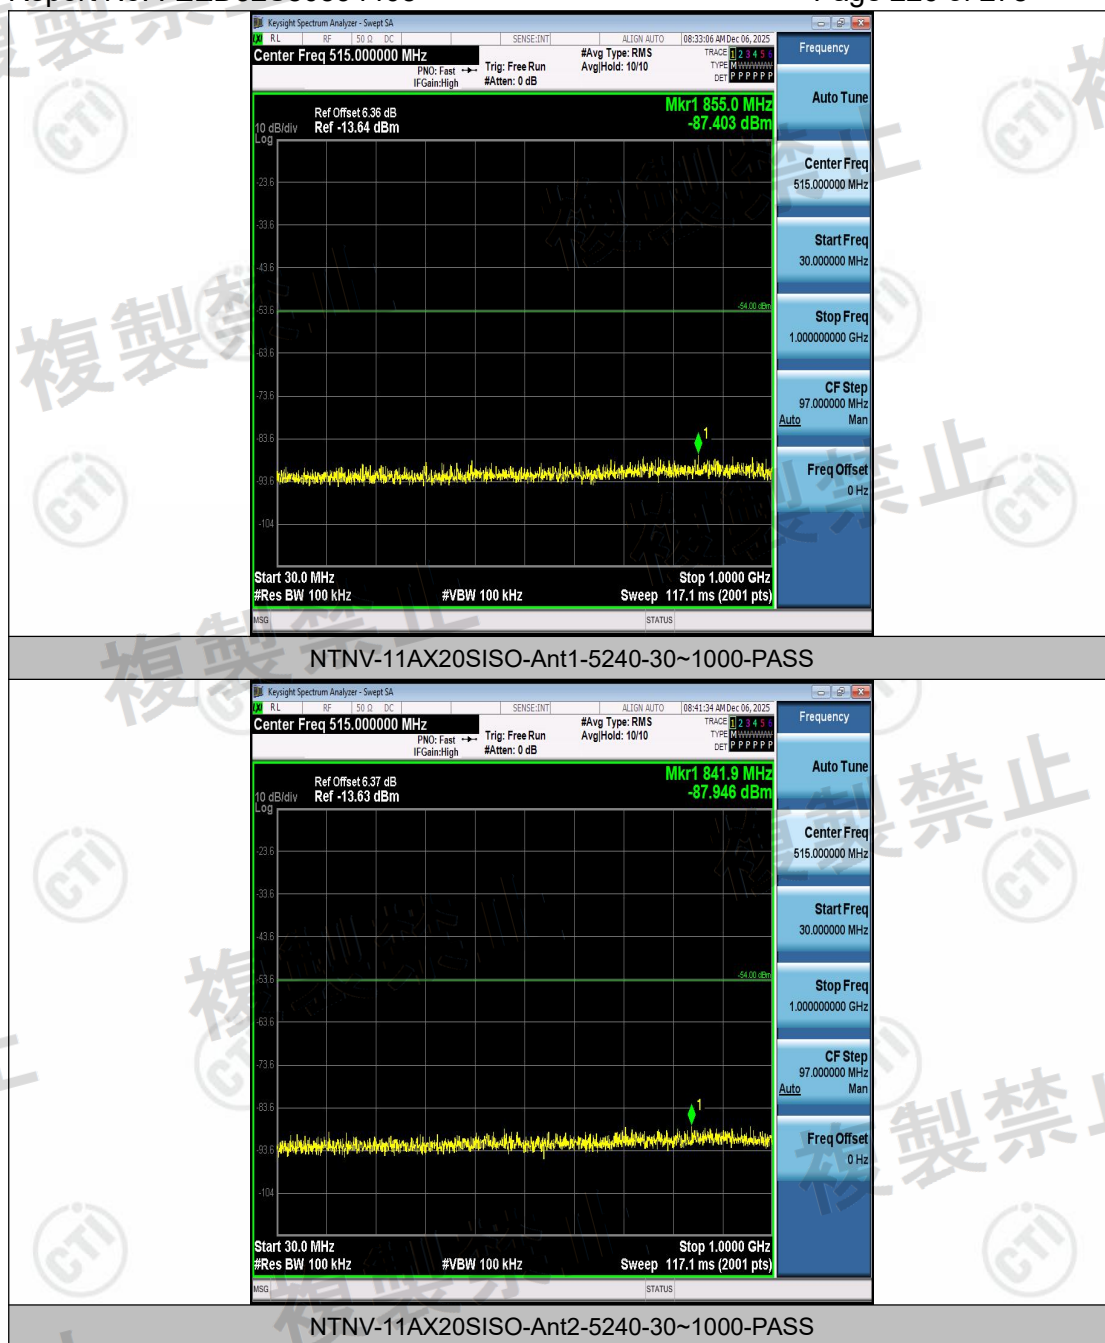


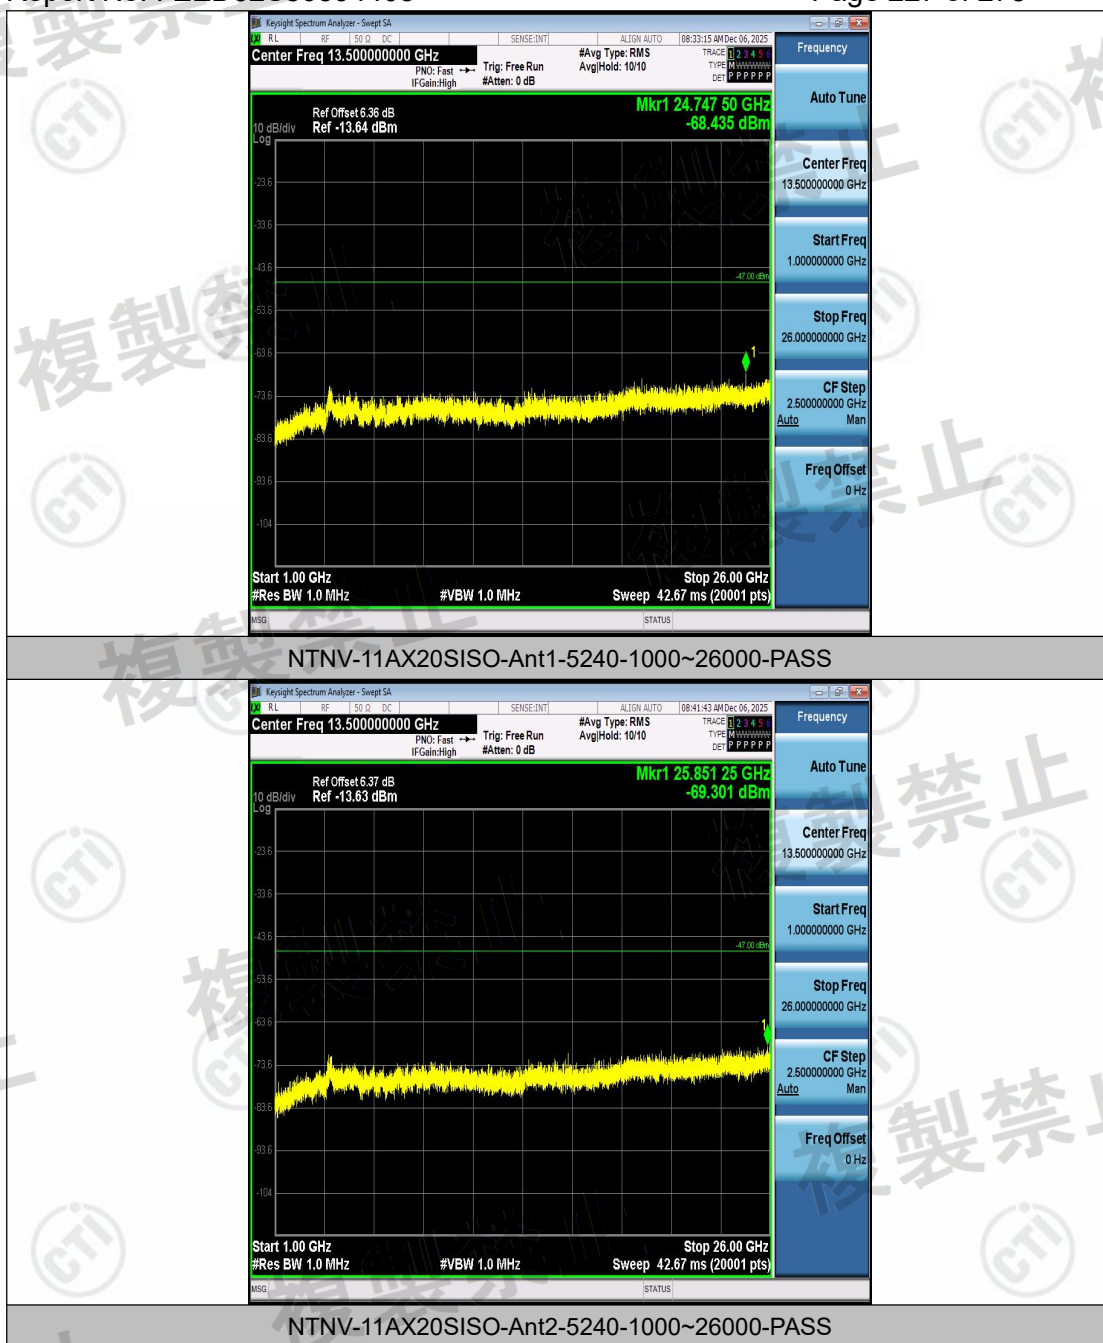


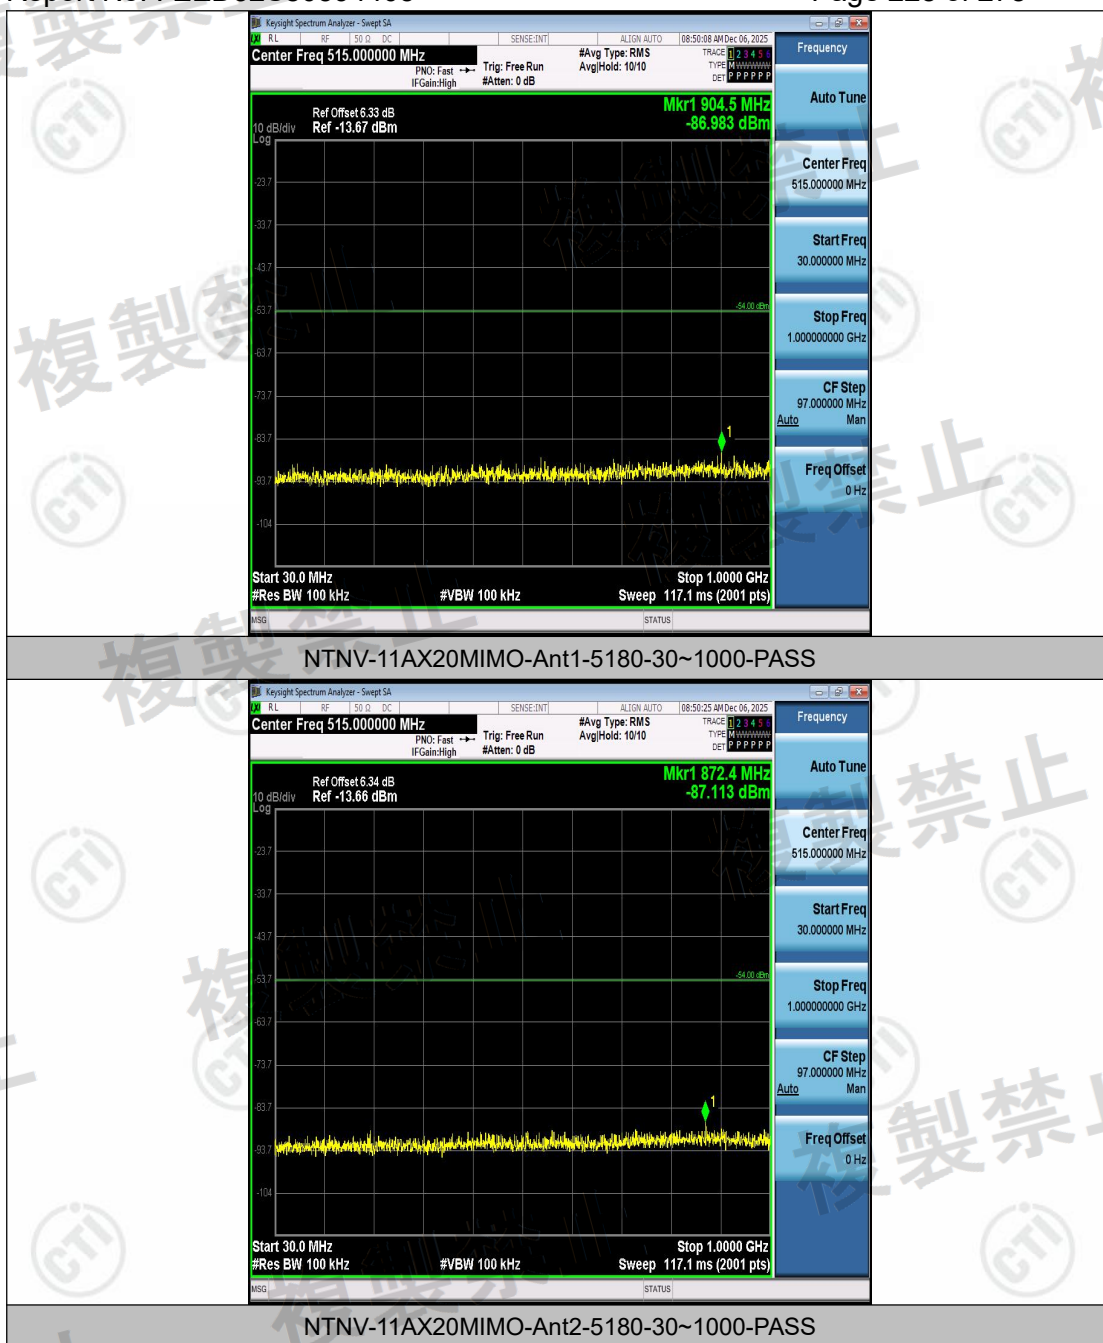


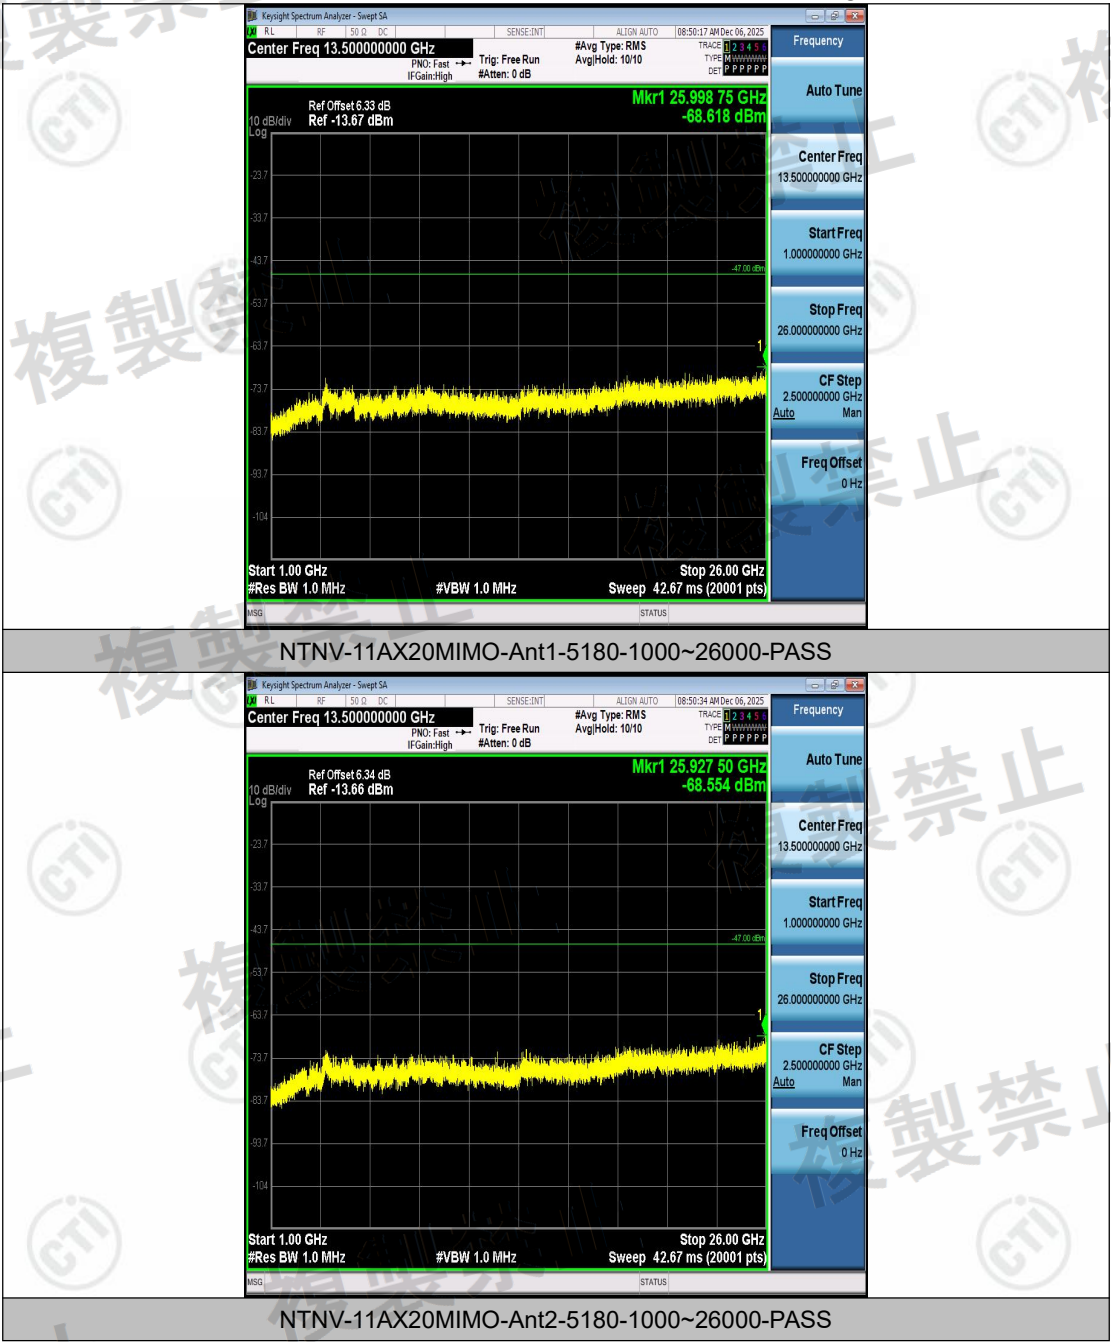


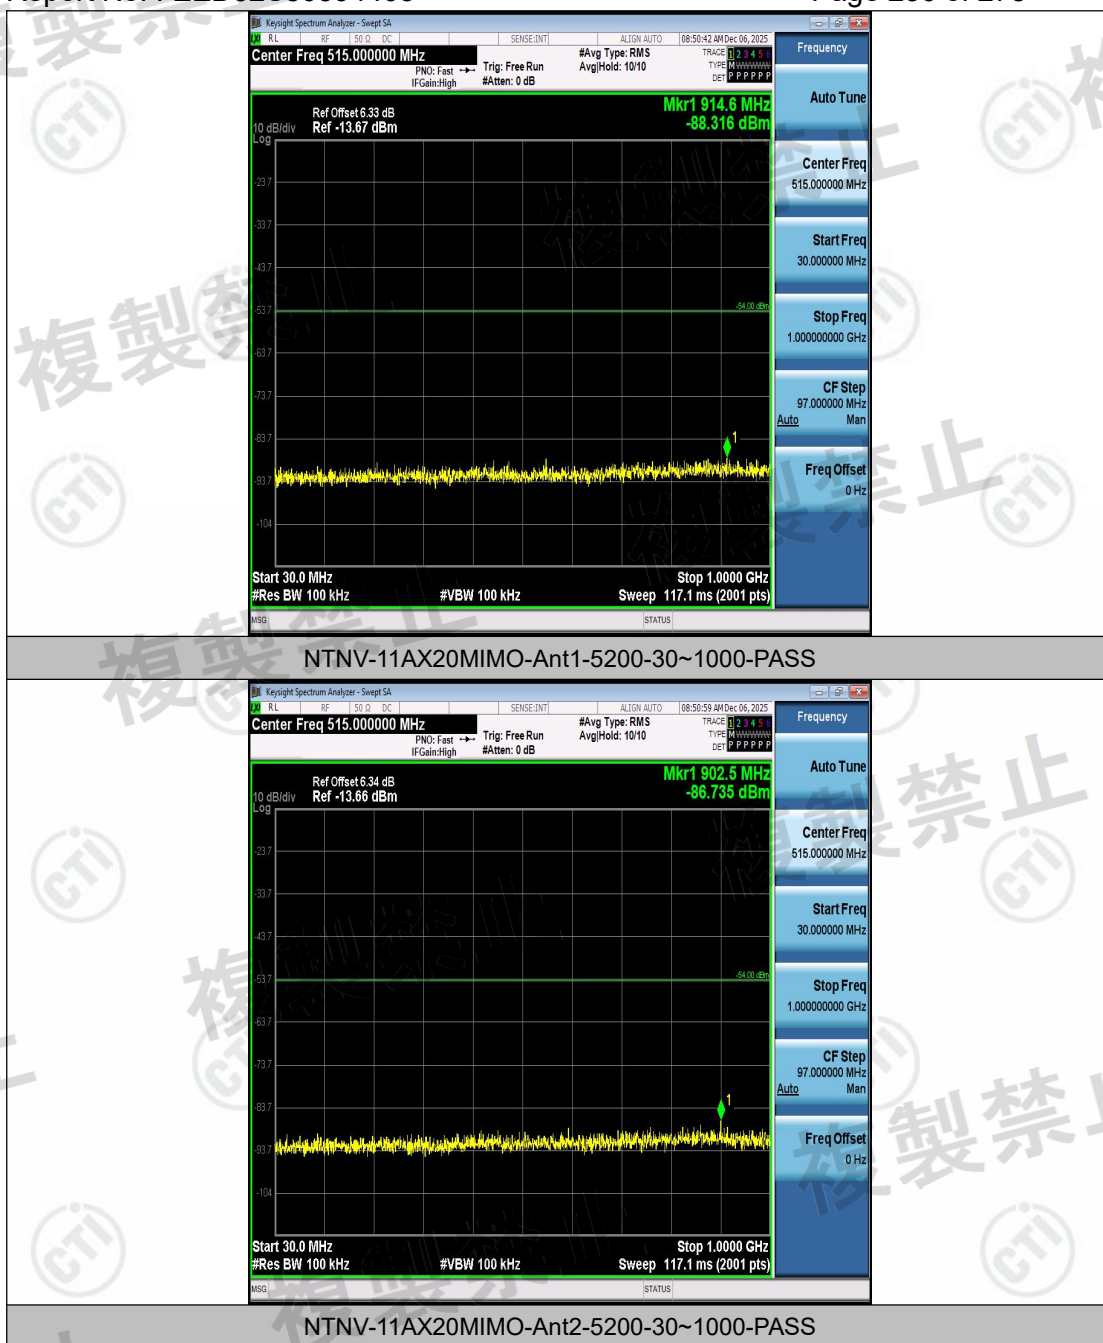


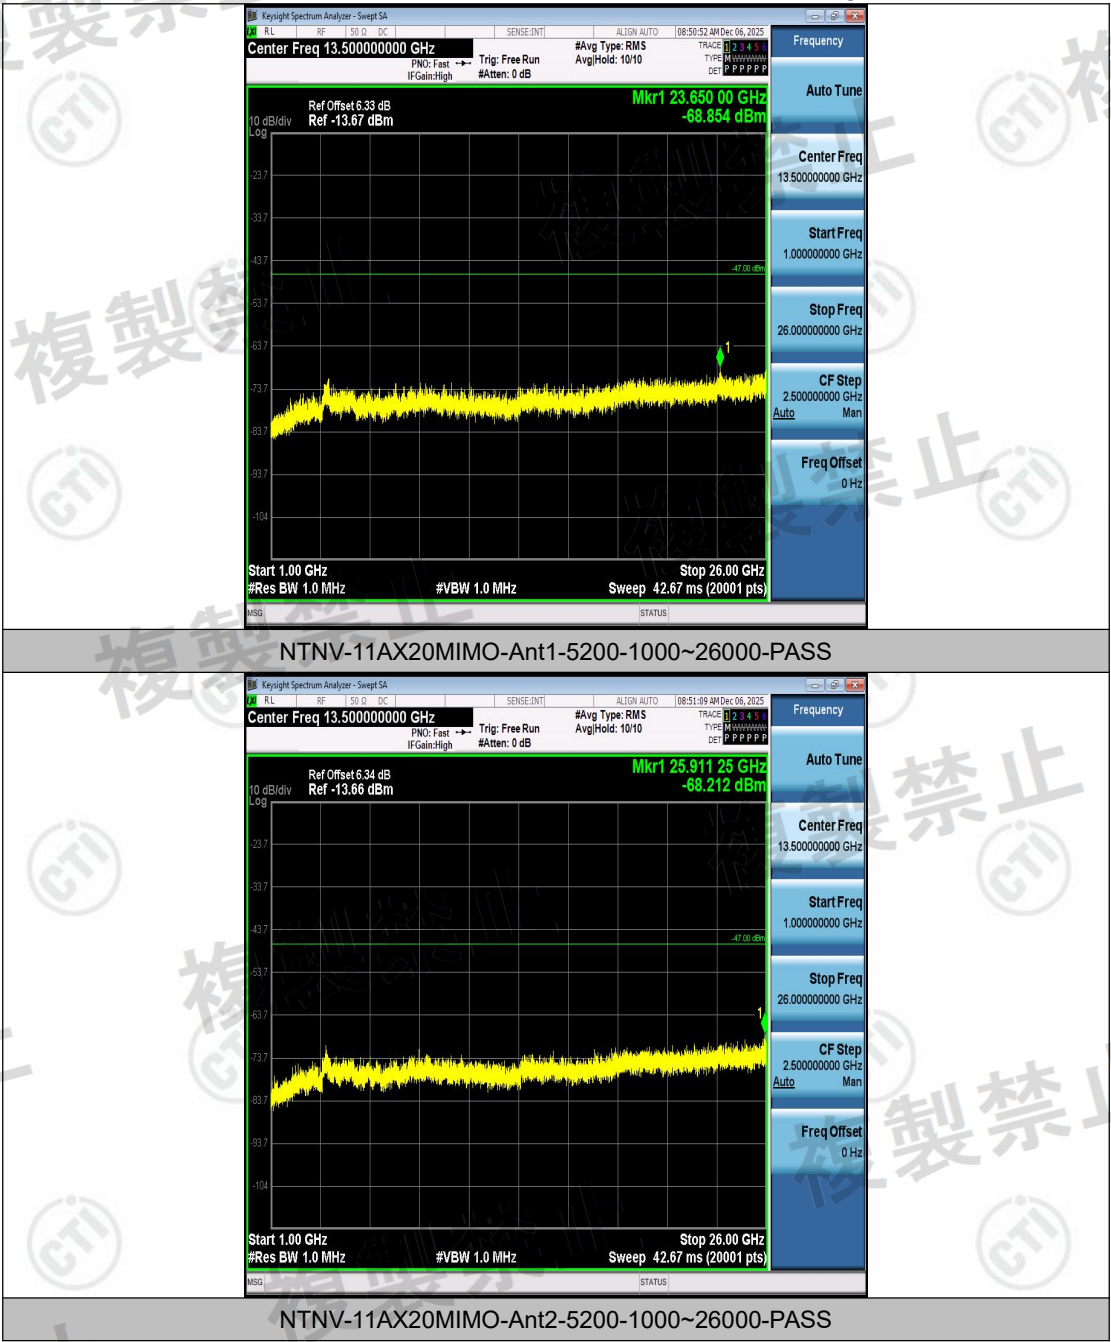


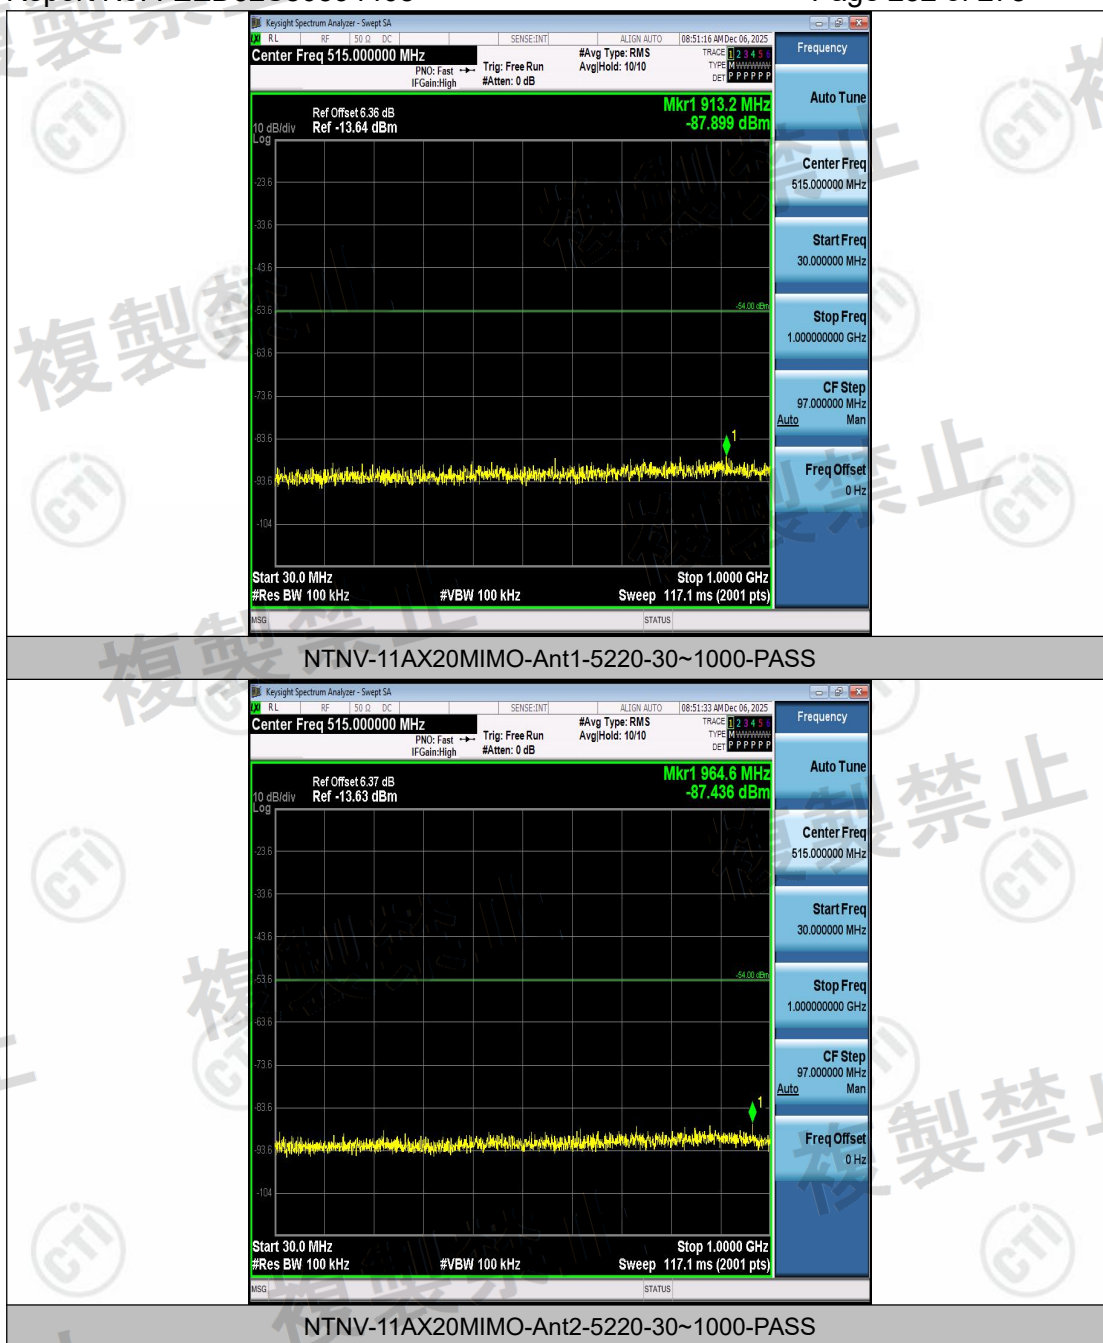


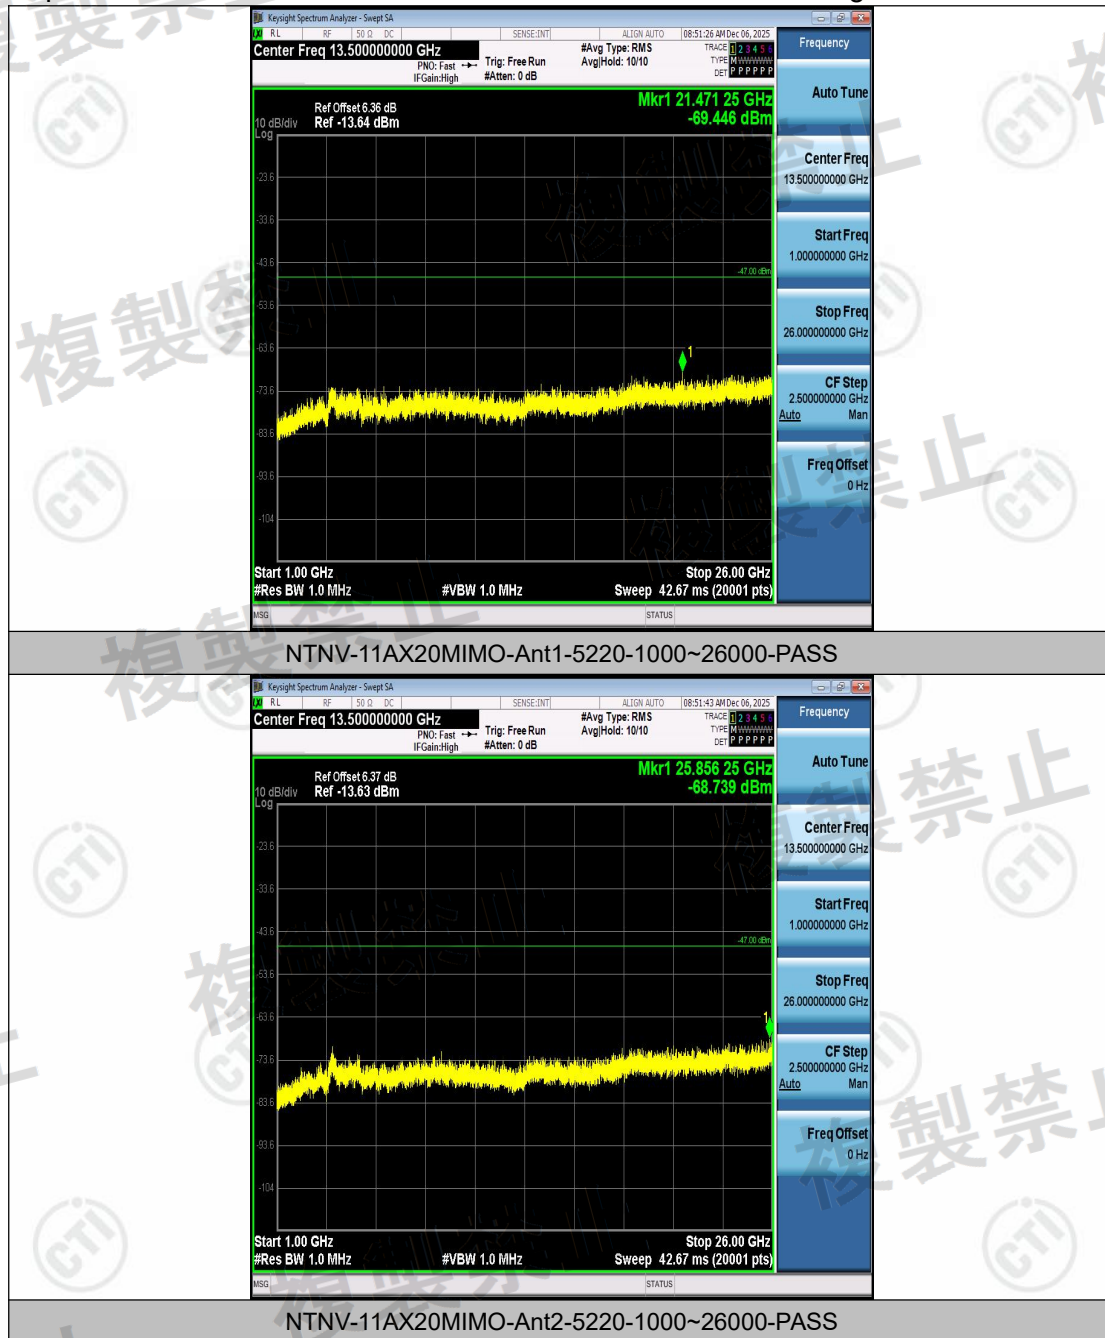


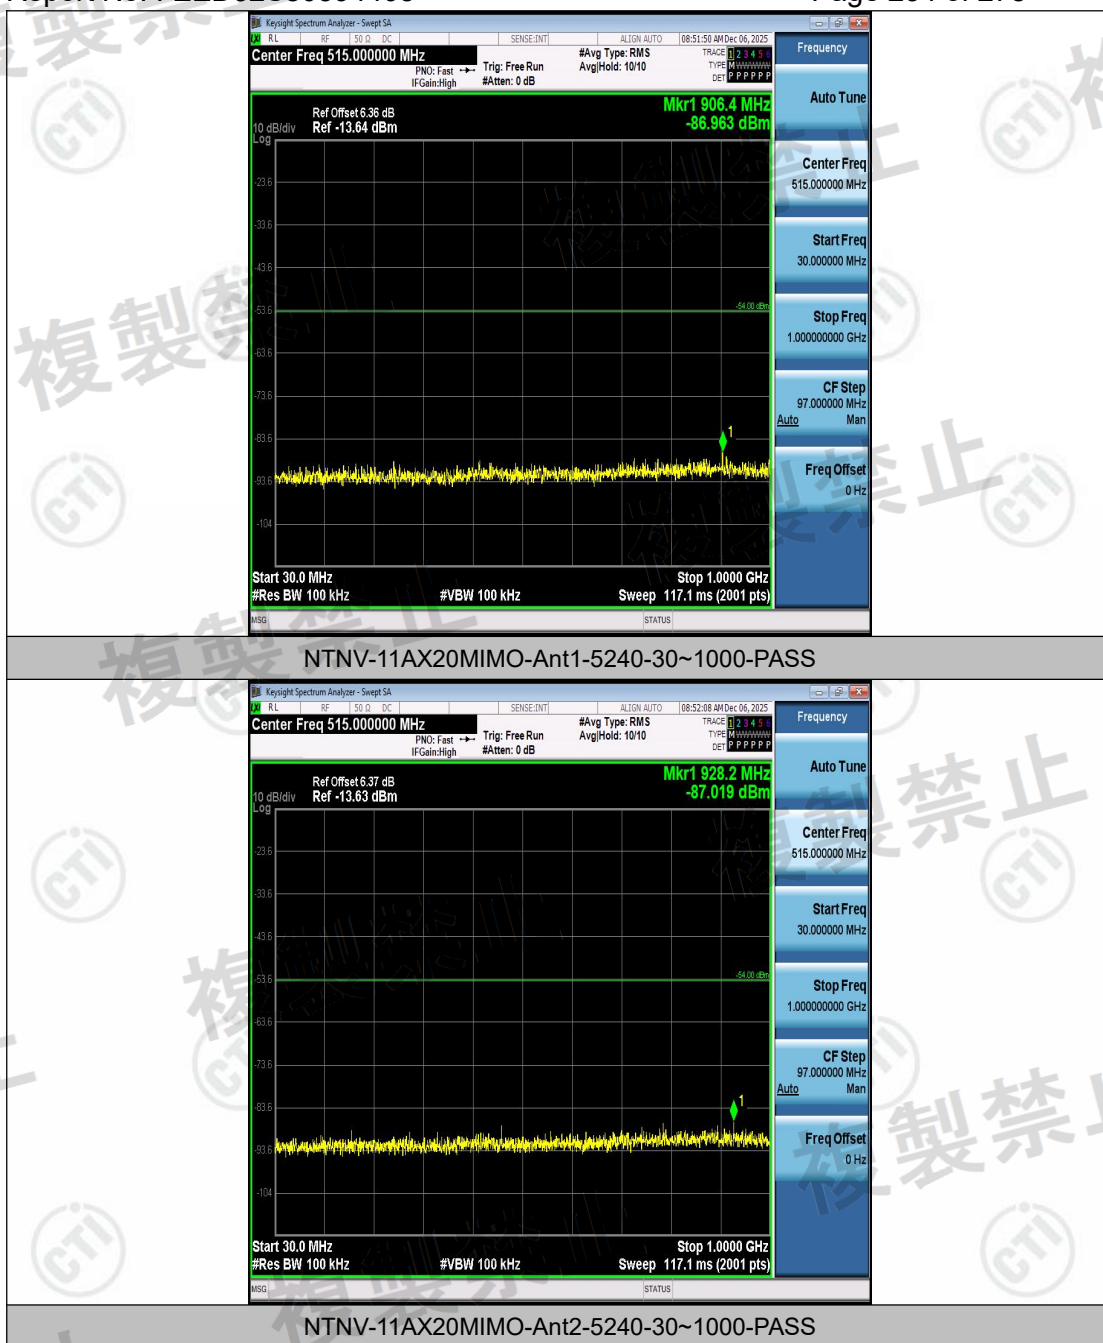


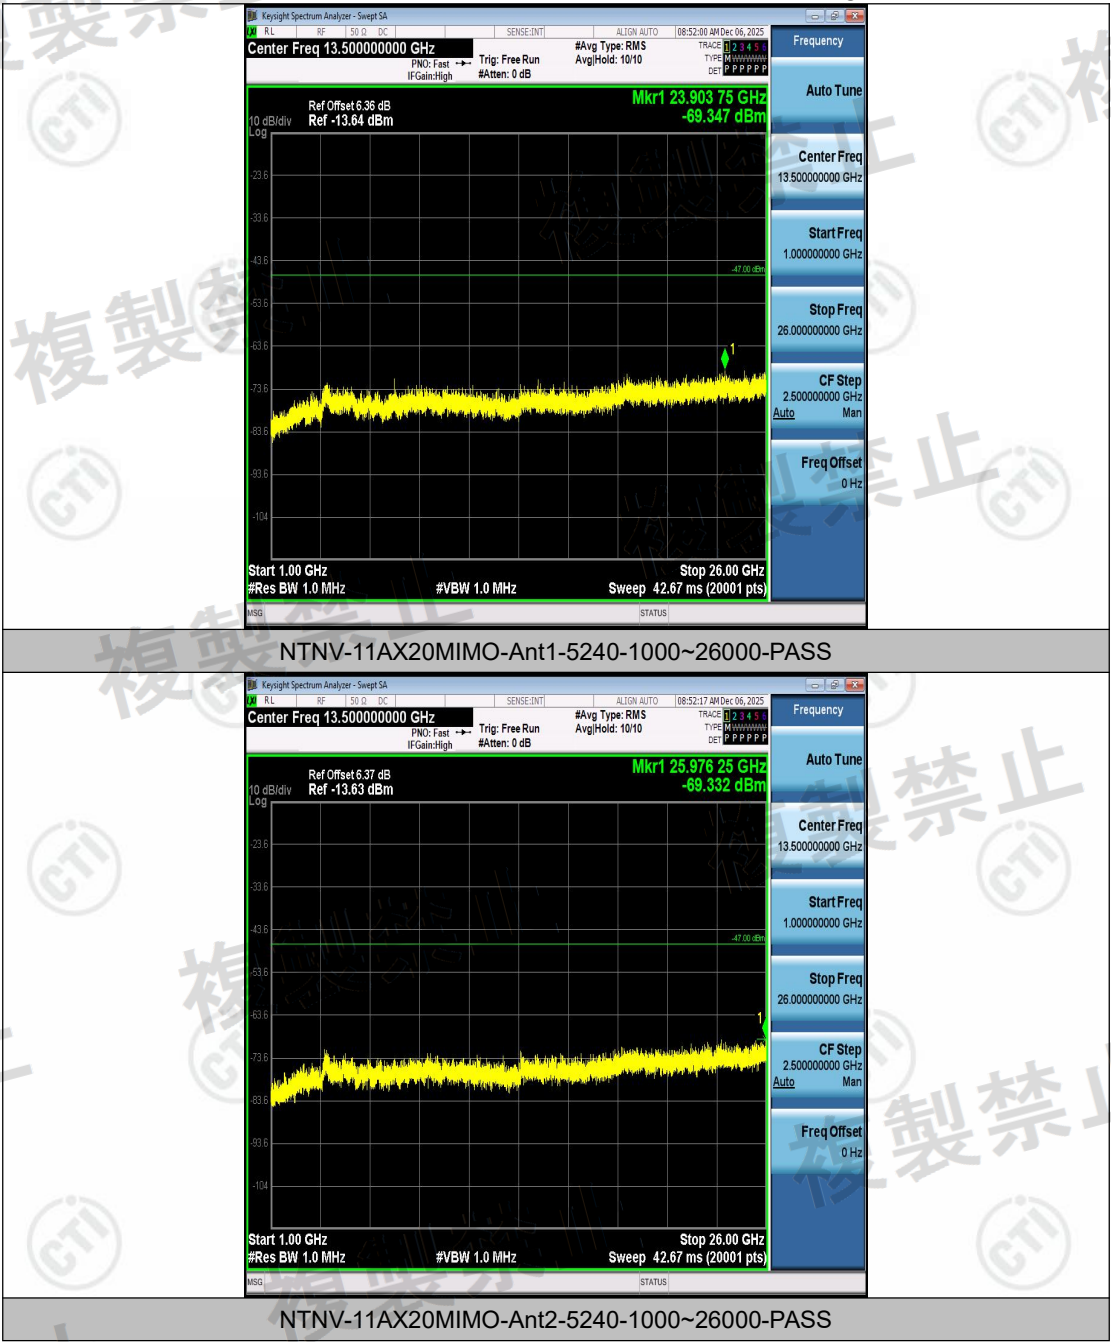


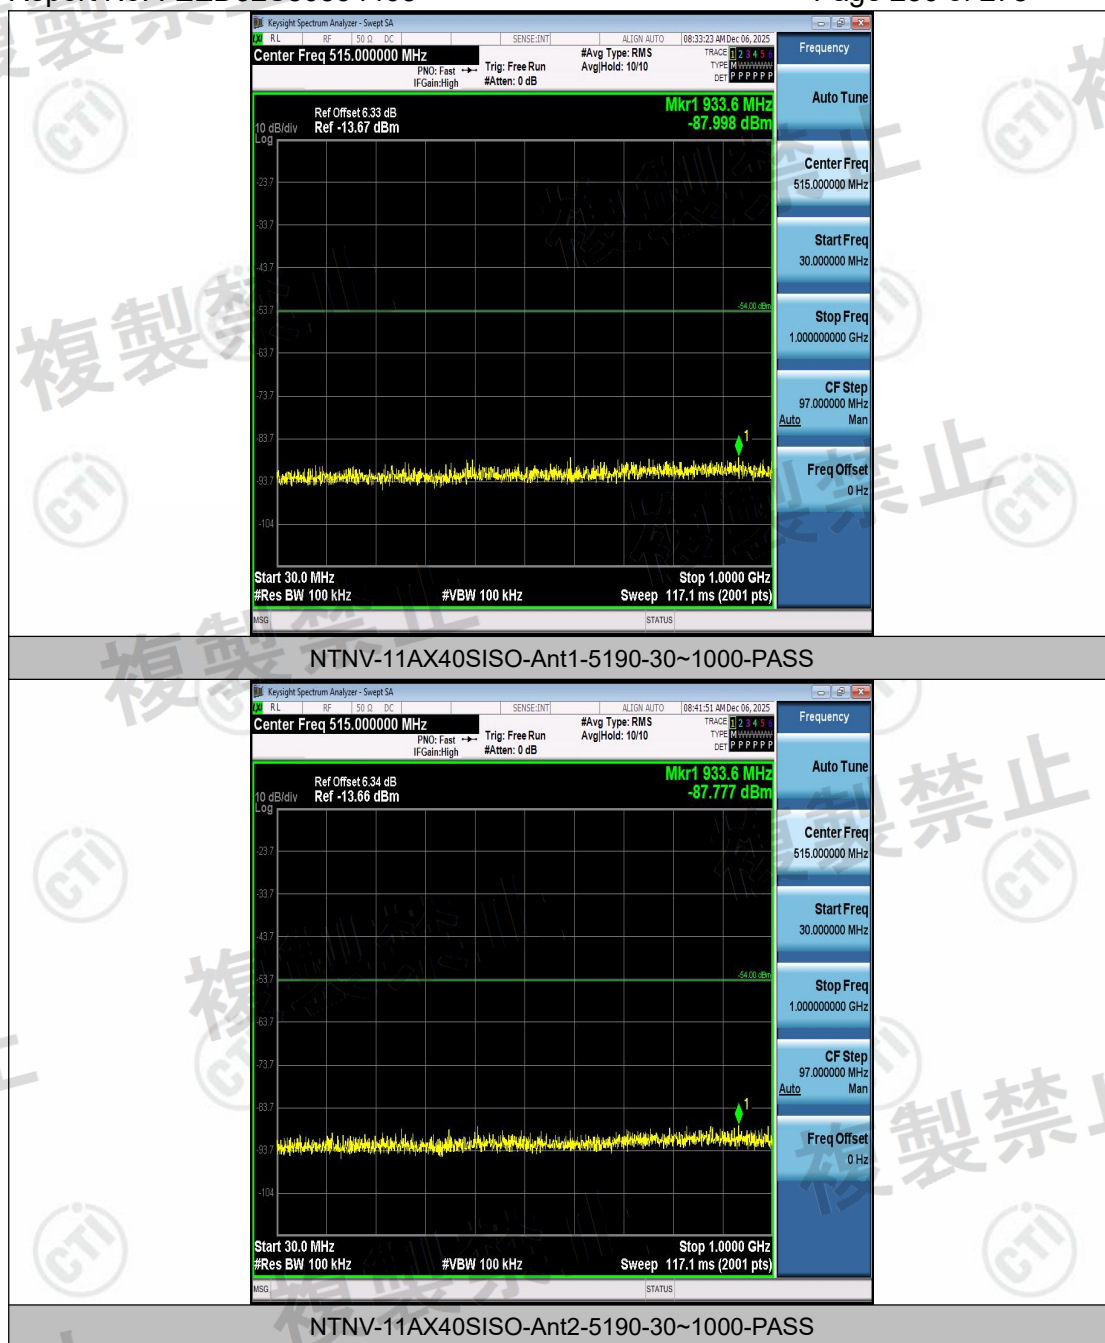


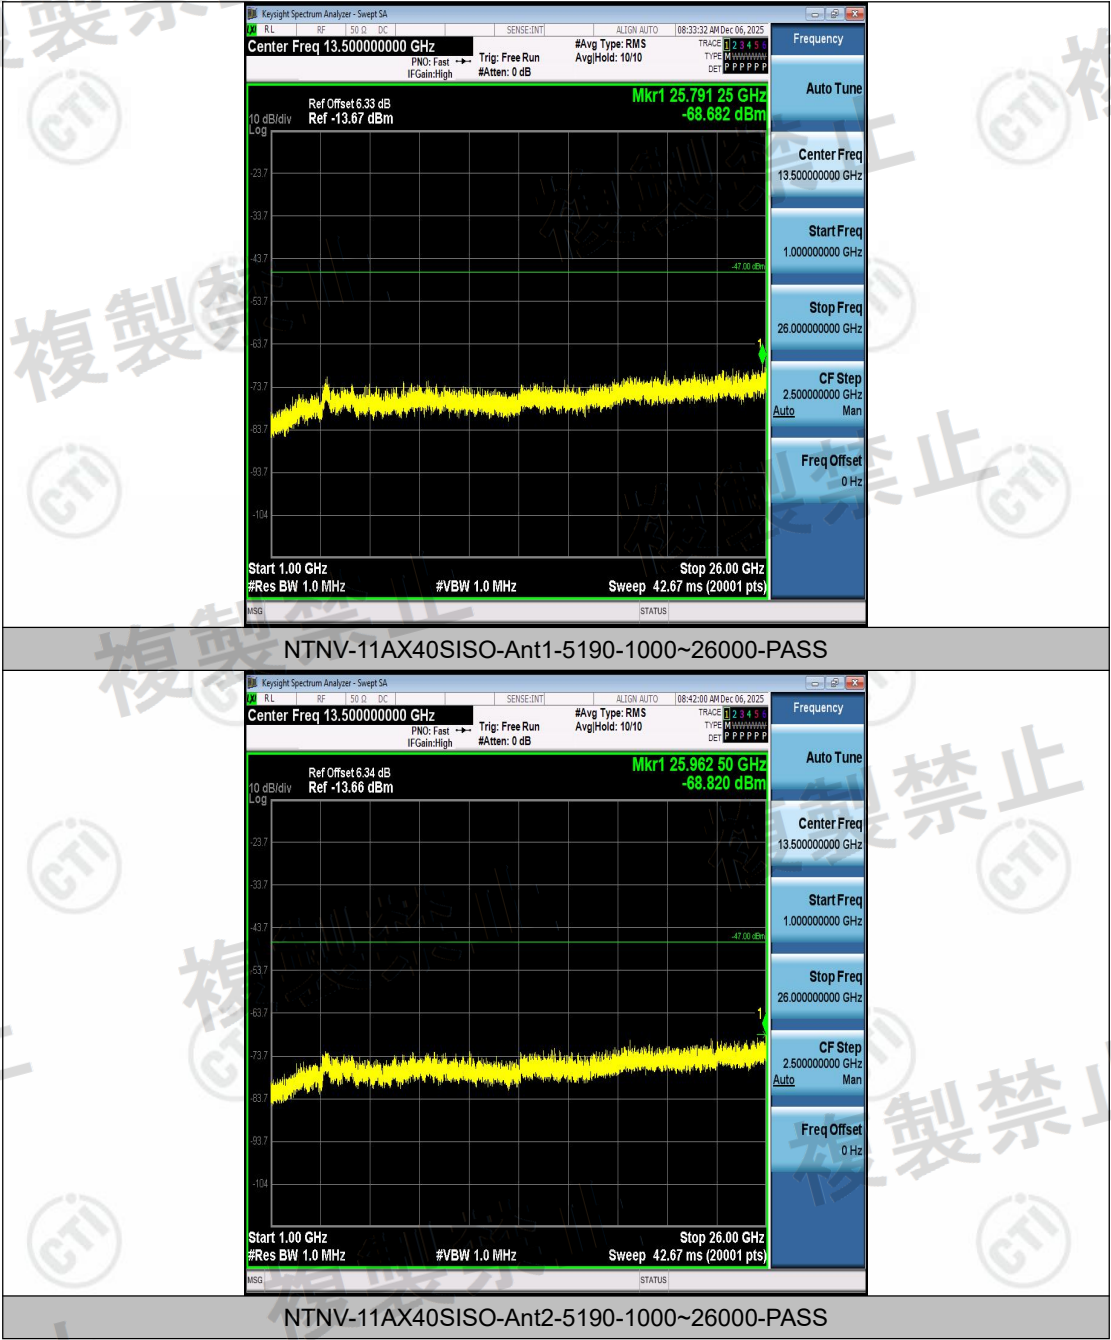


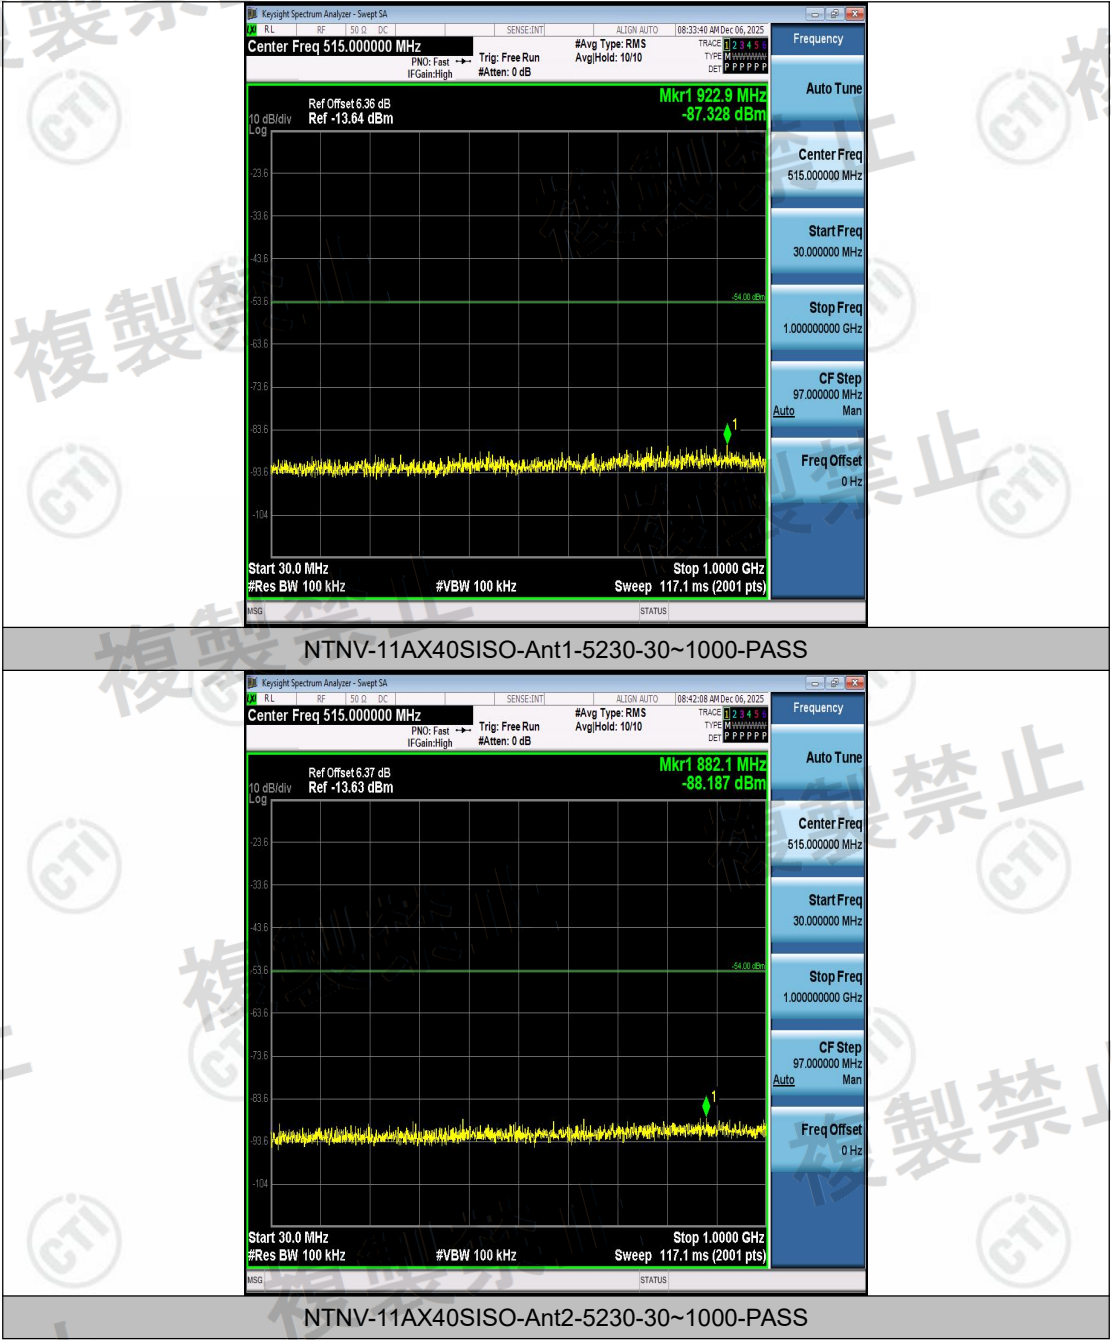


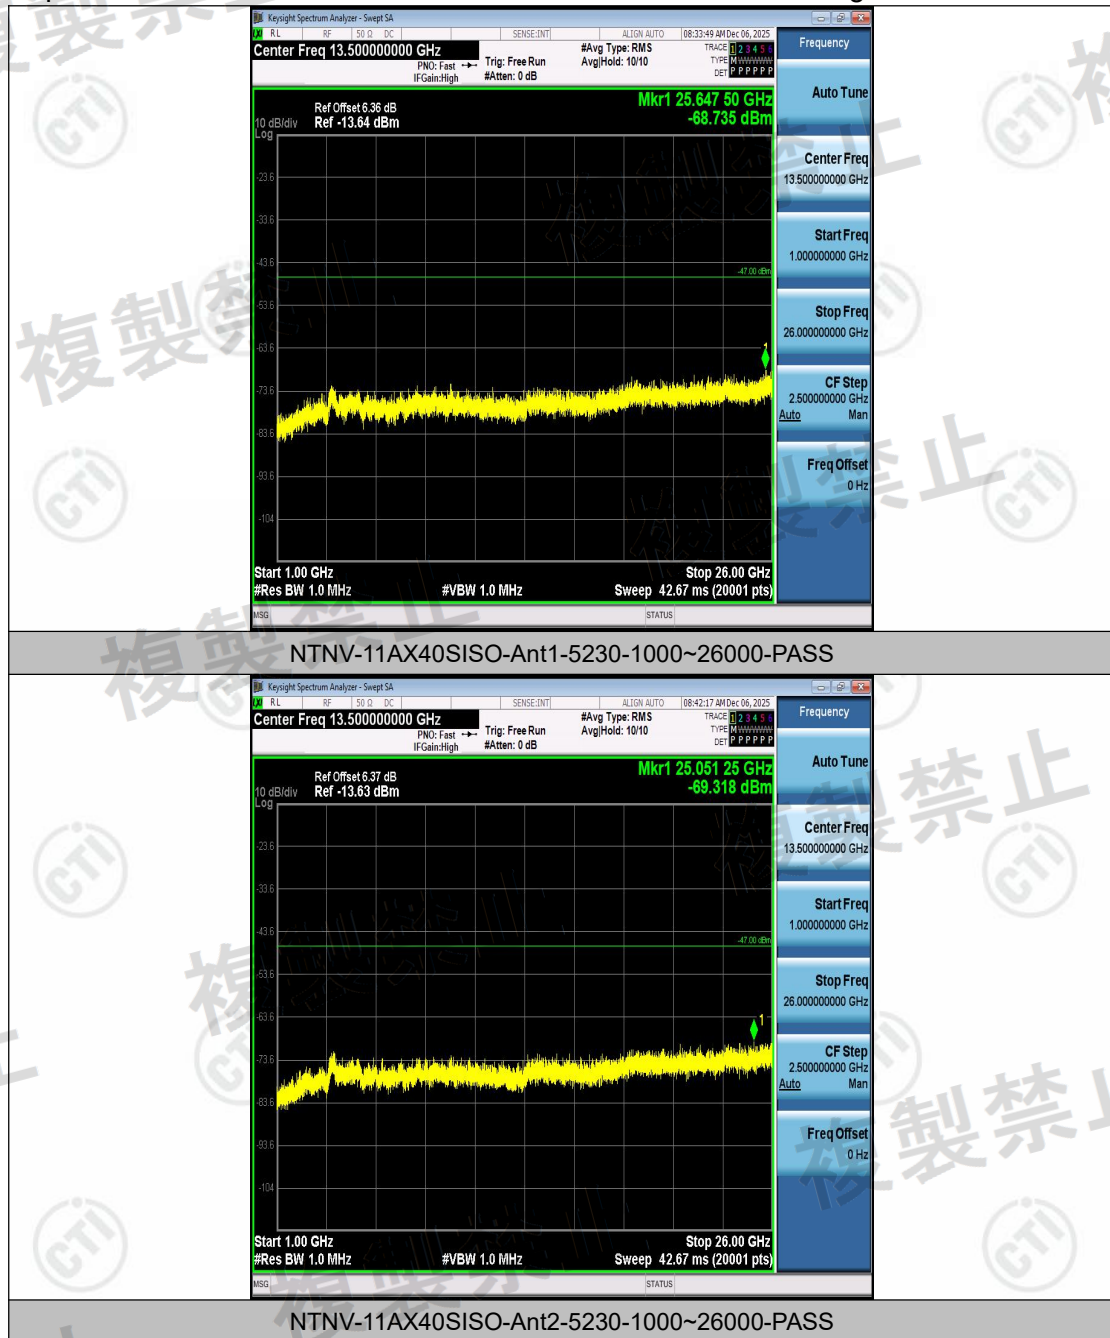


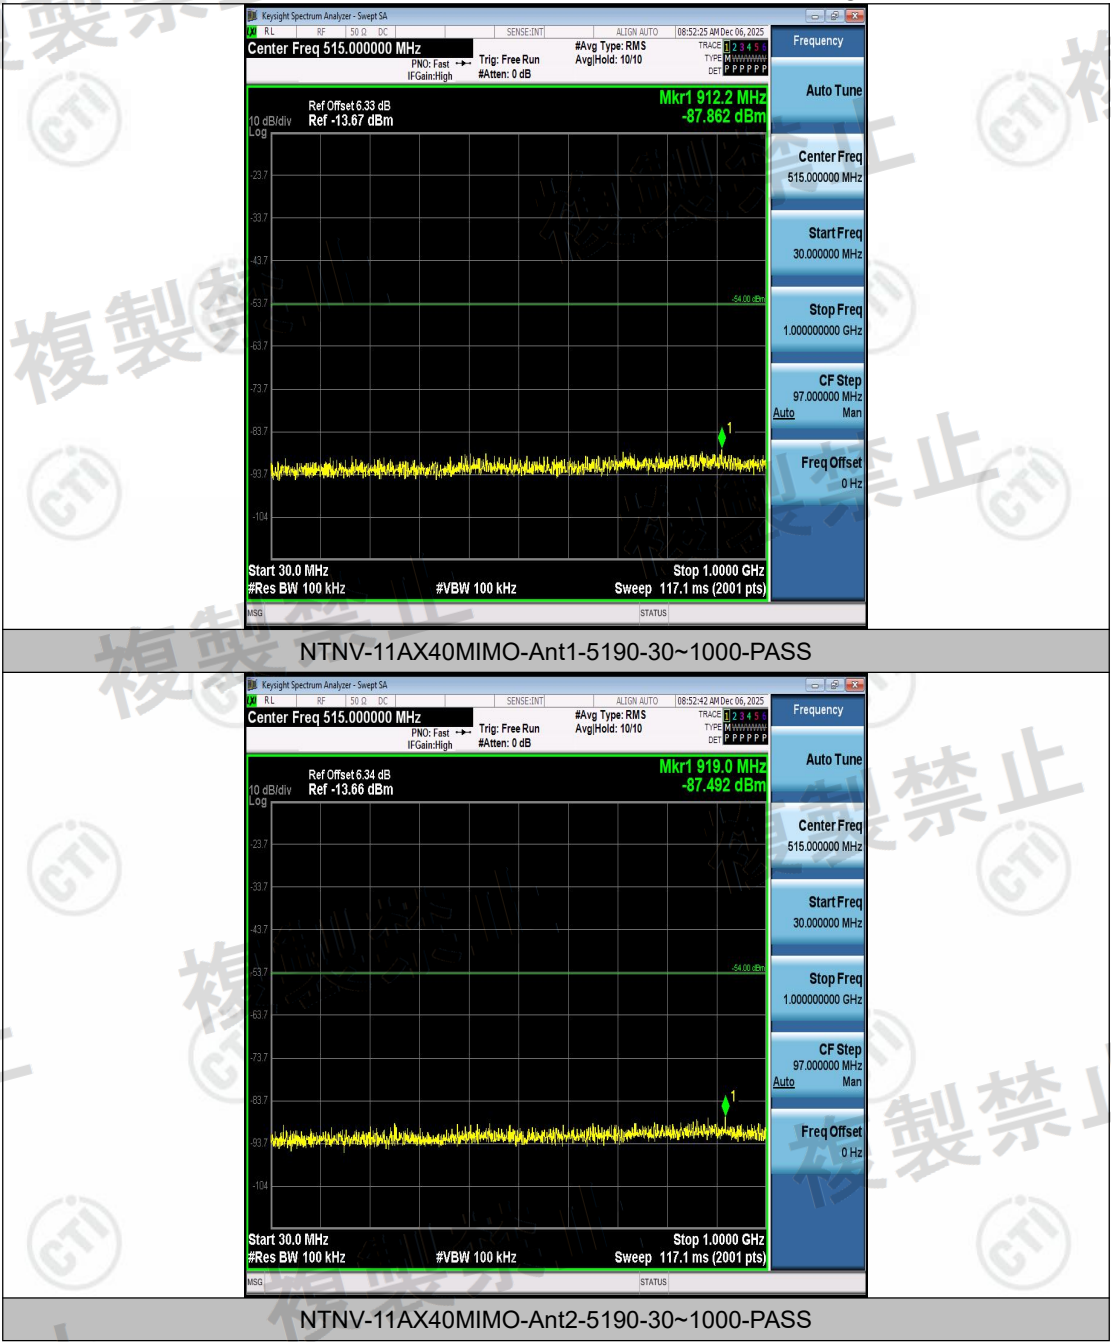


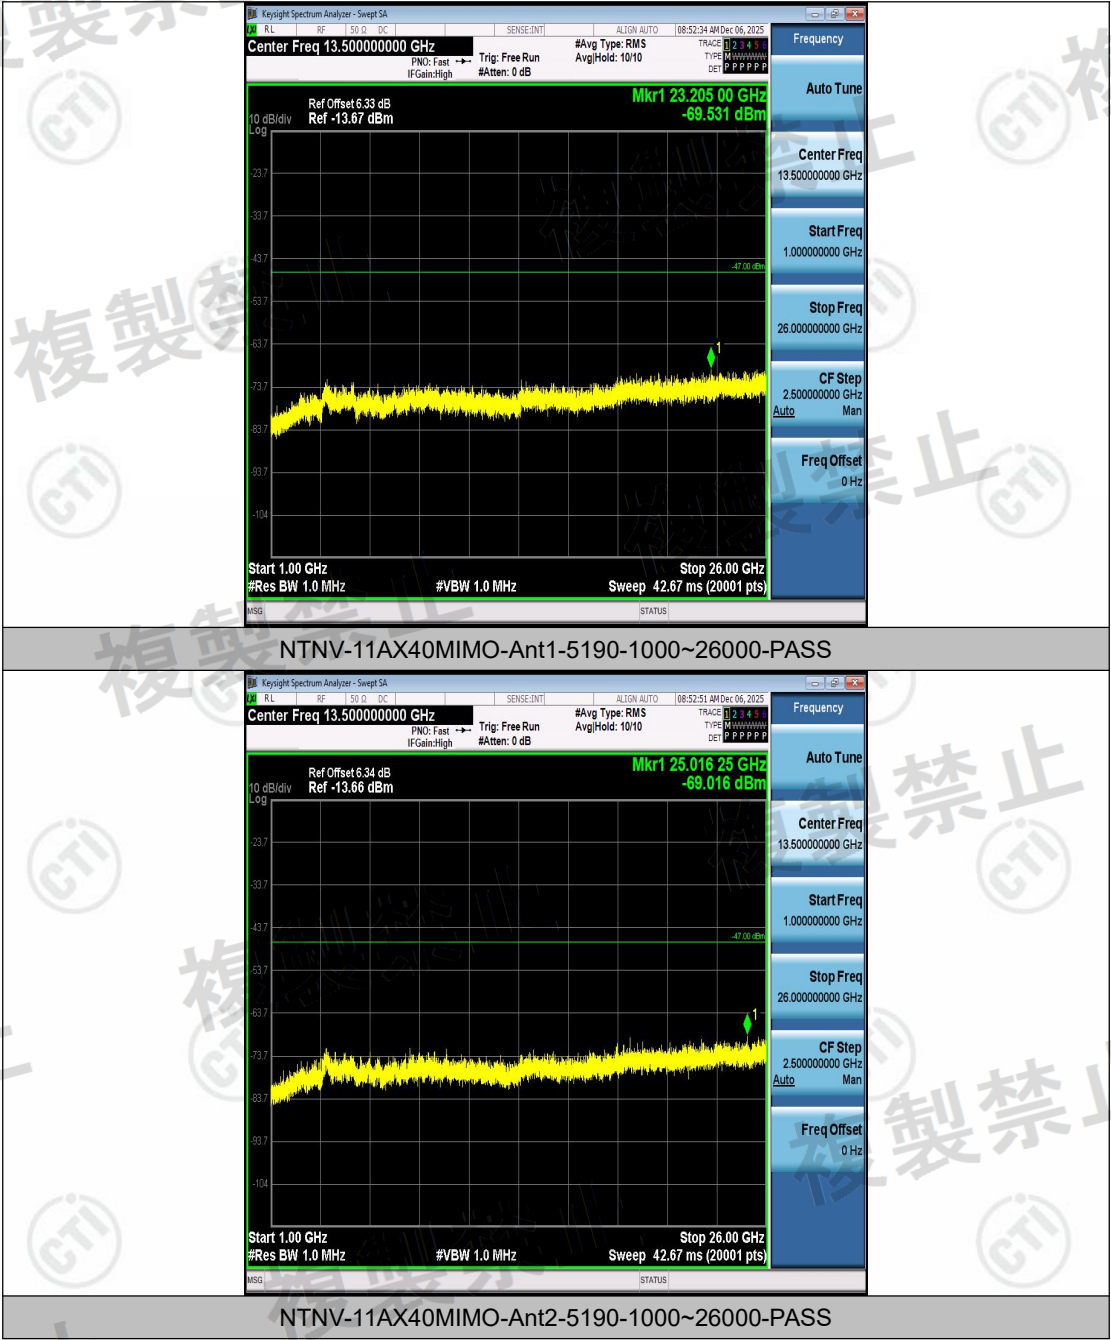


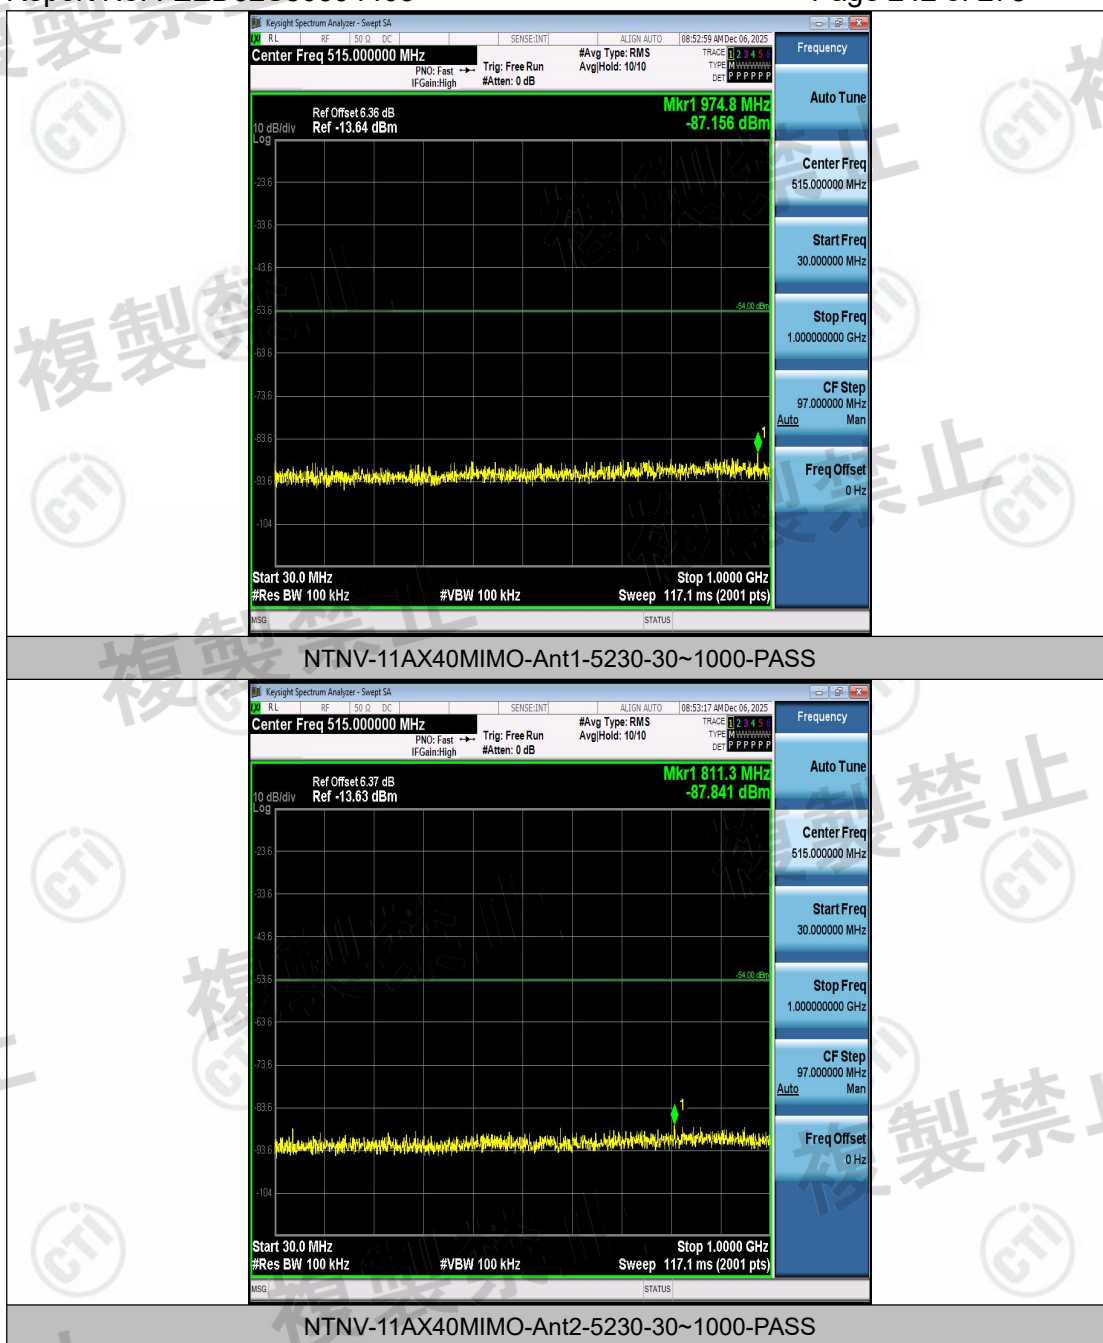


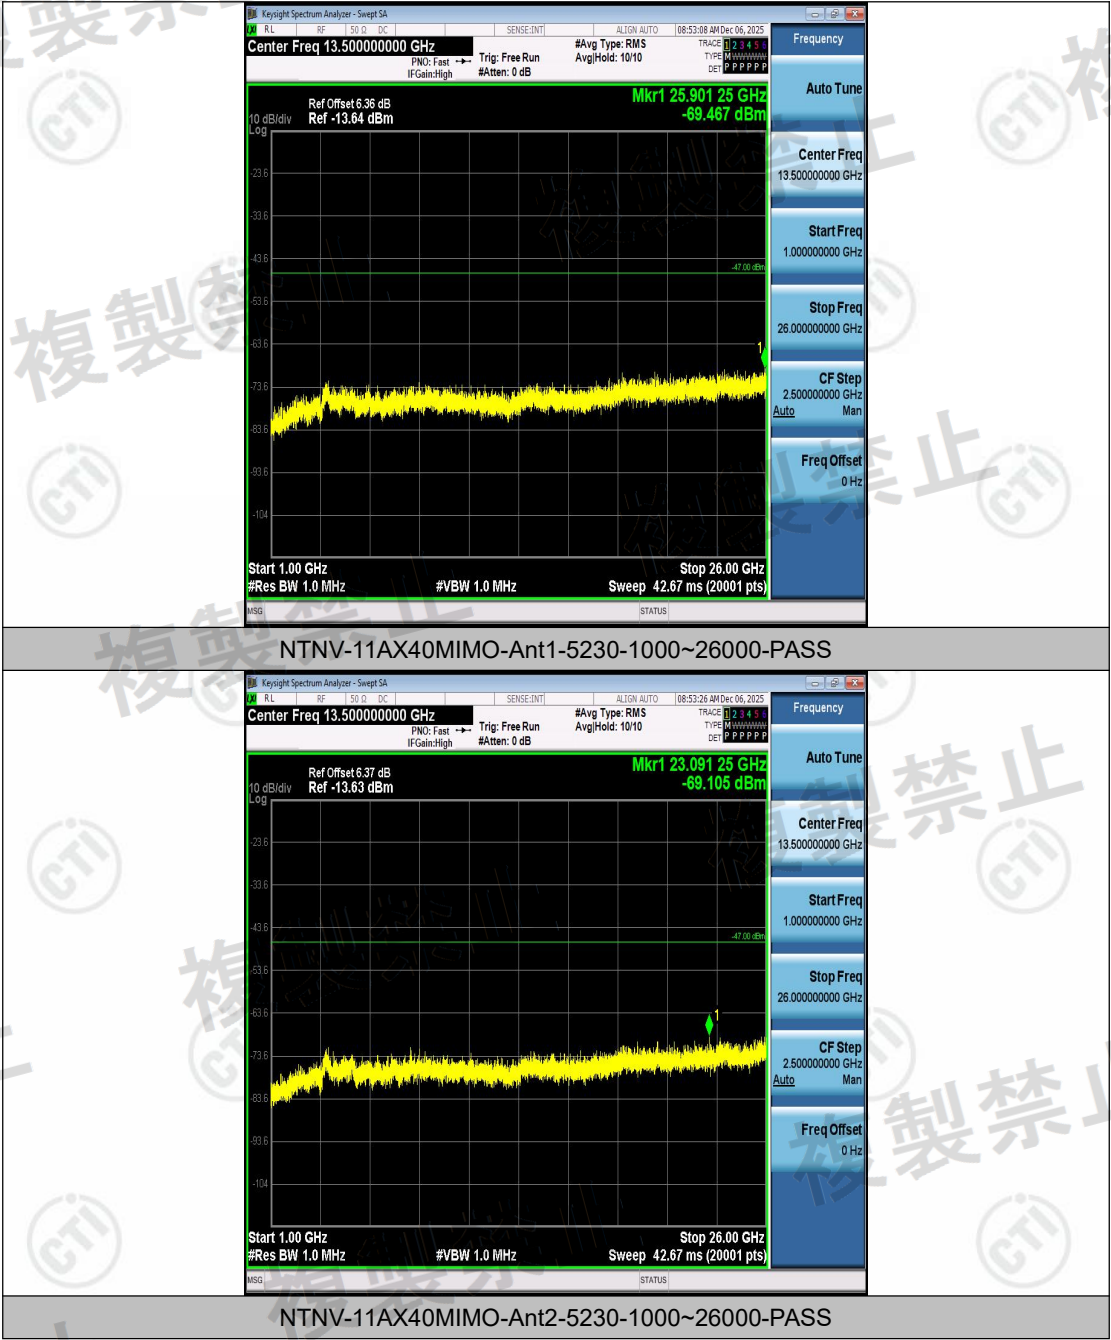

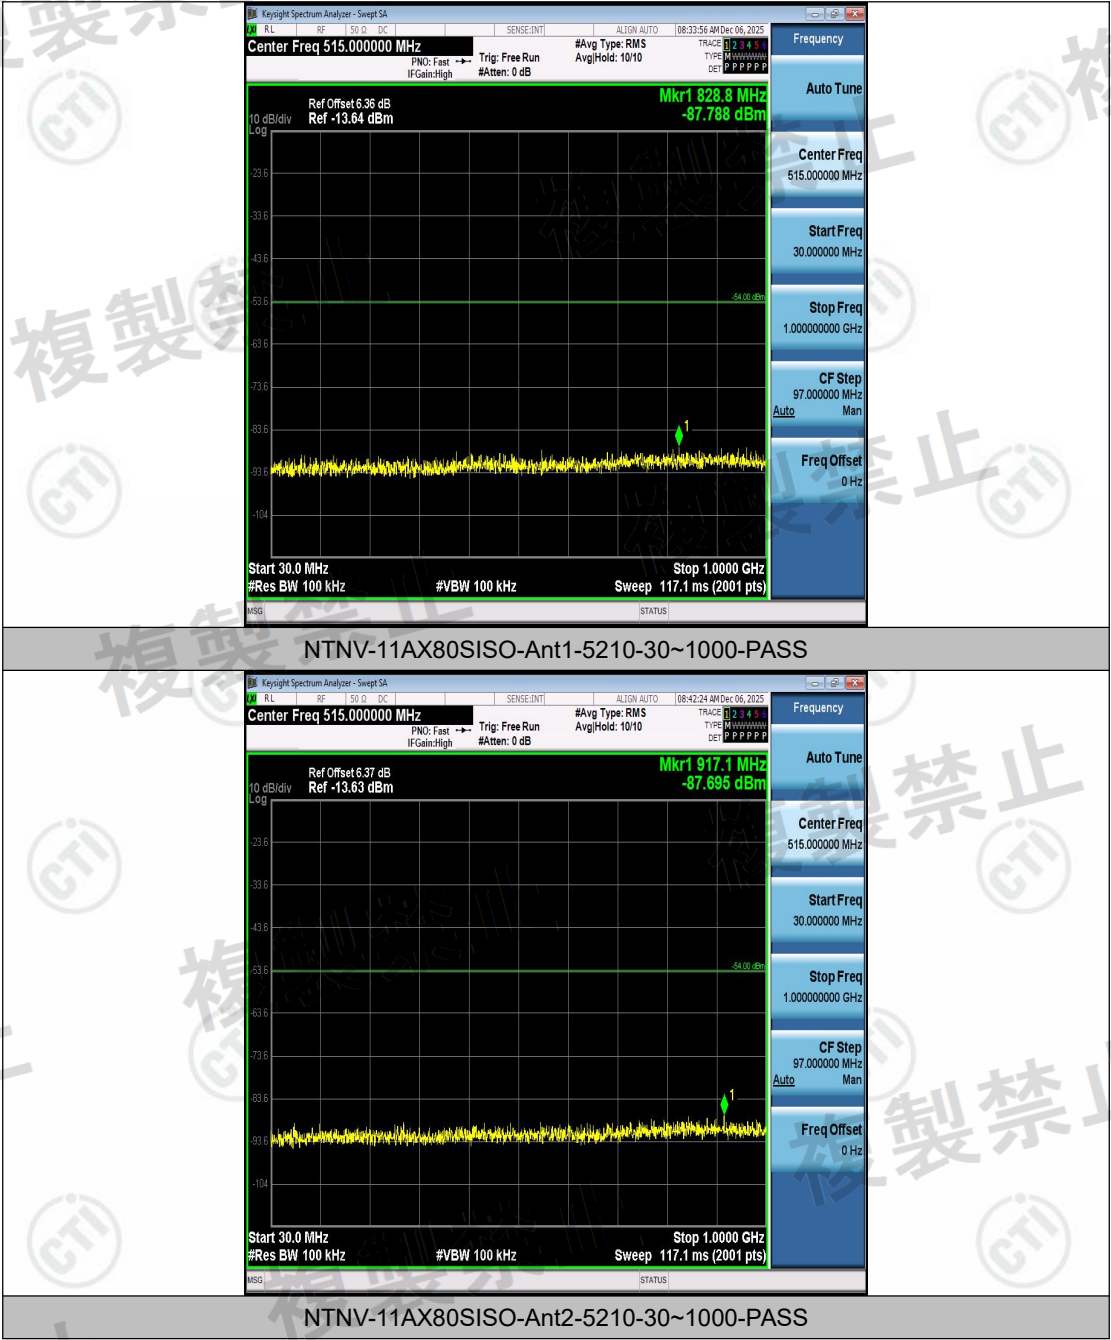

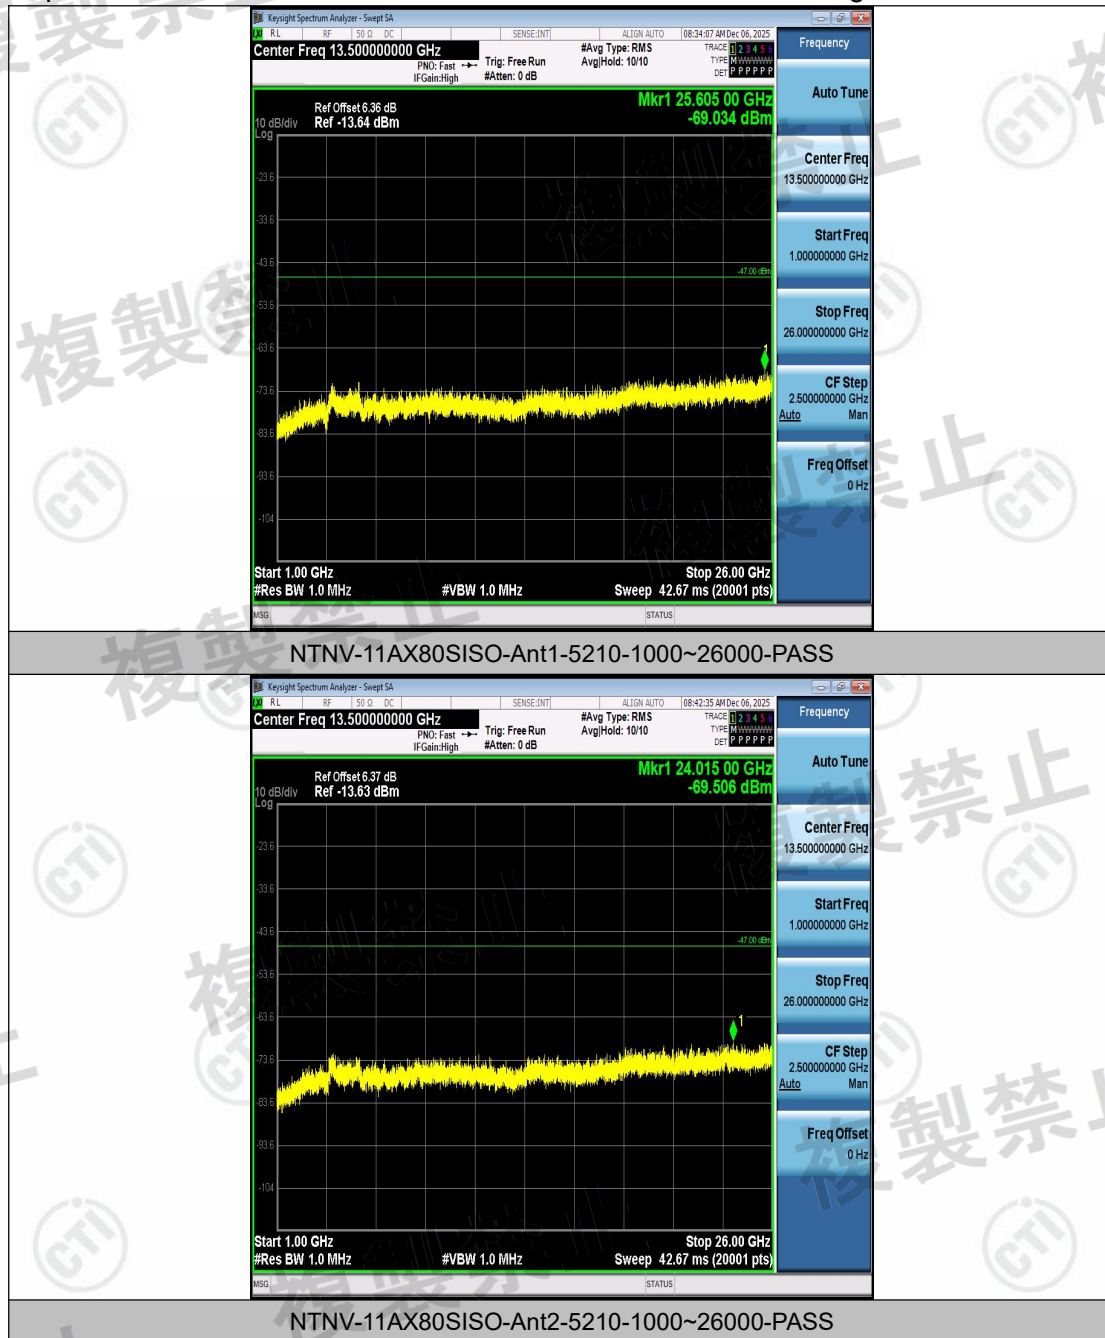

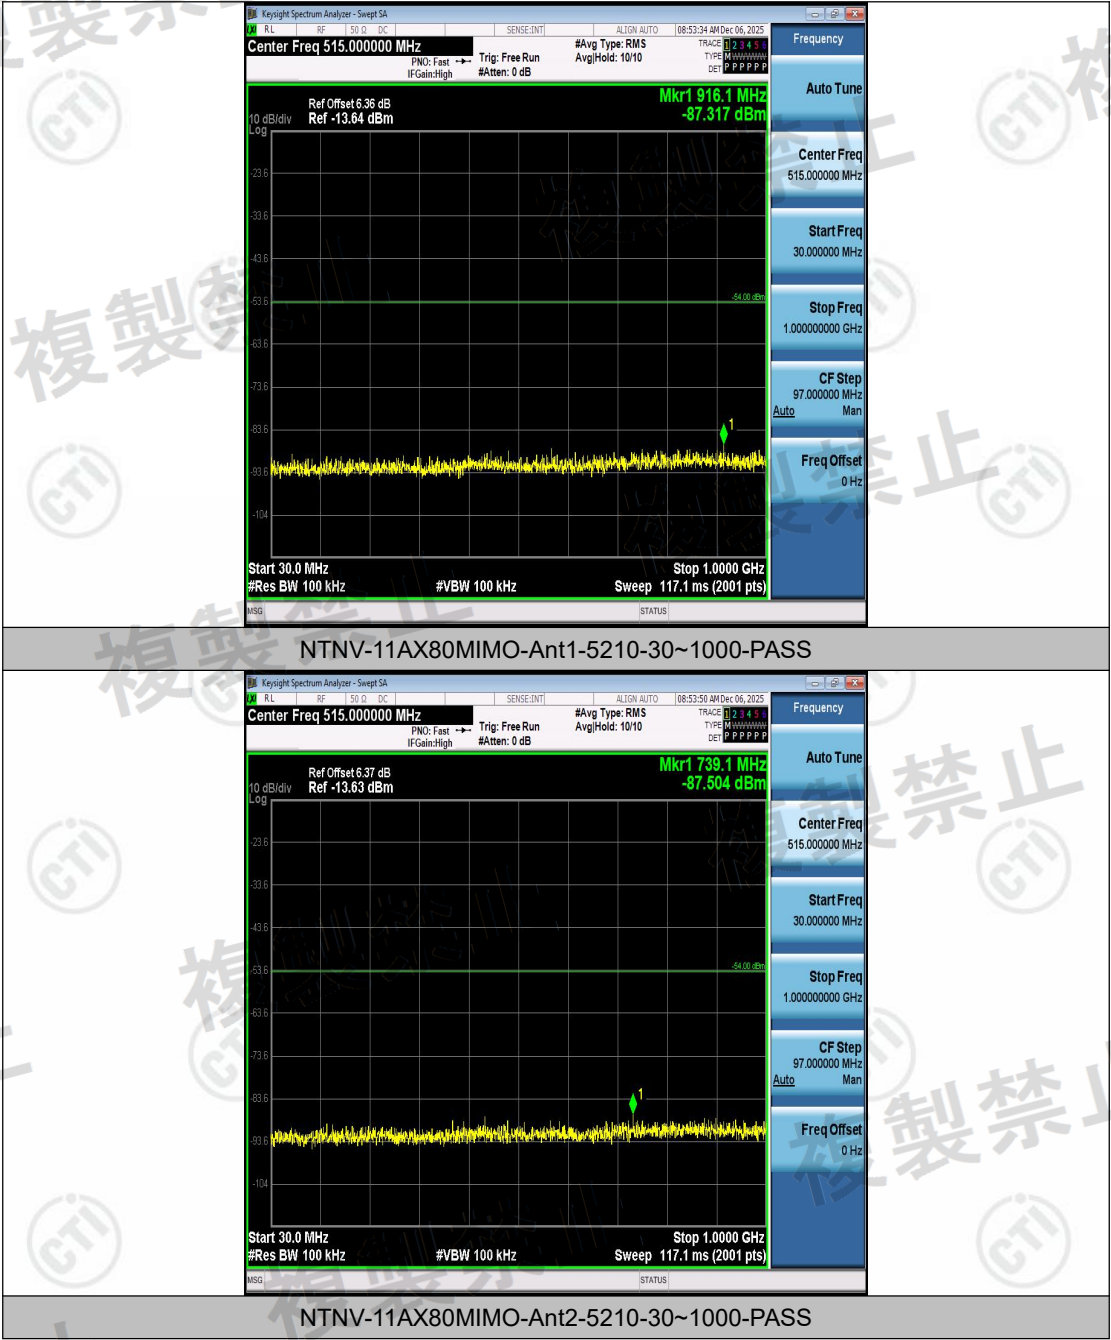

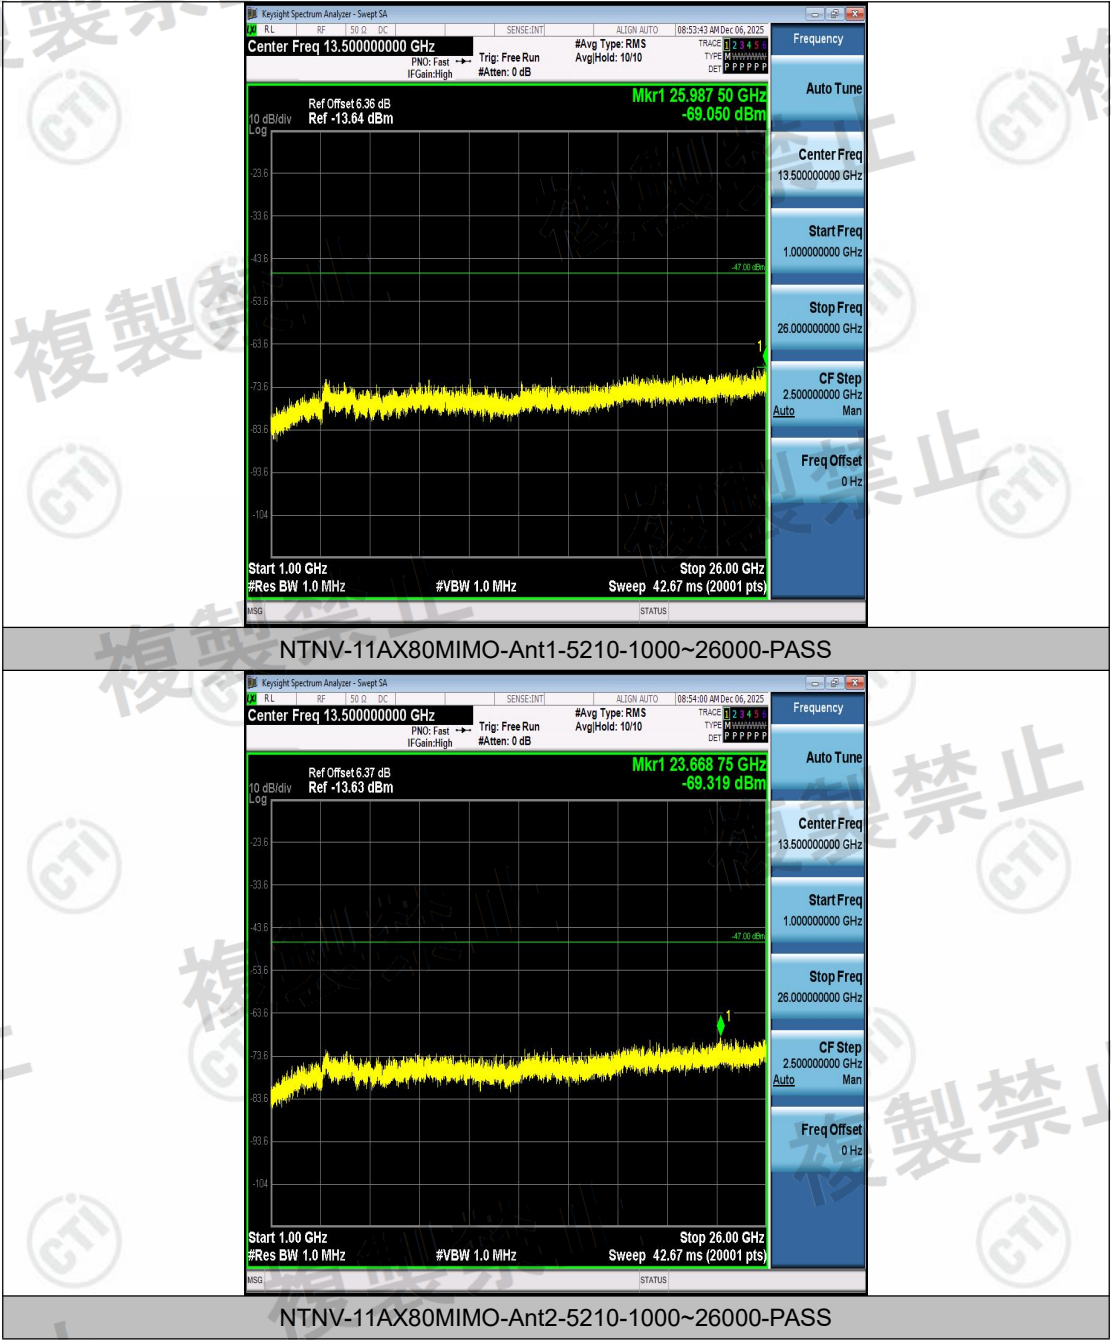

Appendix G: Transmission Burst Length

Test Result

TestCondition	TestMode	Antenna	Frequency[MHz]	Result[ms]	Limit[ms]	Verdict
NTNV	11A	Ant2	5180	1.46	≤8	PASS
NTNV	11A	Ant2	5200	1.46	≤8	PASS
NTNV	11A	Ant2	5220	1.46	≤8	PASS
NTNV	11A	Ant2	5240	1.46	≤8	PASS
NTNV	11N20SISO	Ant2	5180	5.39	≤8	PASS
NTNV	11N20SISO	Ant2	5200	5.39	≤8	PASS
NTNV	11N20SISO	Ant2	5220	5.39	≤8	PASS
NTNV	11N20SISO	Ant2	5240	5.39	≤8	PASS
NTNV	11N40SISO	Ant2	5190	5.19	≤8	PASS
NTNV	11N40SISO	Ant2	5230	5.18	≤8	PASS
NTNV	11AC20SISO	Ant2	5180	5.39	≤8	PASS
NTNV	11AC20SISO	Ant2	5200	5.39	≤8	PASS
NTNV	11AC20SISO	Ant2	5220	5.39	≤8	PASS
NTNV	11AC20SISO	Ant2	5240	5.39	≤8	PASS
NTNV	11AC40SISO	Ant2	5190	5.19	≤8	PASS
NTNV	11AC40SISO	Ant2	5230	5.19	≤8	PASS
NTNV	11AC80SISO	Ant2	5210	2.84	≤8	PASS
NTNV	11AX20SISO	Ant2	5180	5.39	≤8	PASS
NTNV	11AX20SISO	Ant2	5200	5.38	≤8	PASS
NTNV	11AX20SISO	Ant2	5220	5.39	≤8	PASS
NTNV	11AX20SISO	Ant2	5240	5.38	≤8	PASS
NTNV	11AX40SISO	Ant2	5190	4.82	≤8	PASS
NTNV	11AX40SISO	Ant2	5230	4.82	≤8	PASS
NTNV	11AX80SISO	Ant2	5210	2.73	≤8	PASS

Test Graphs

