




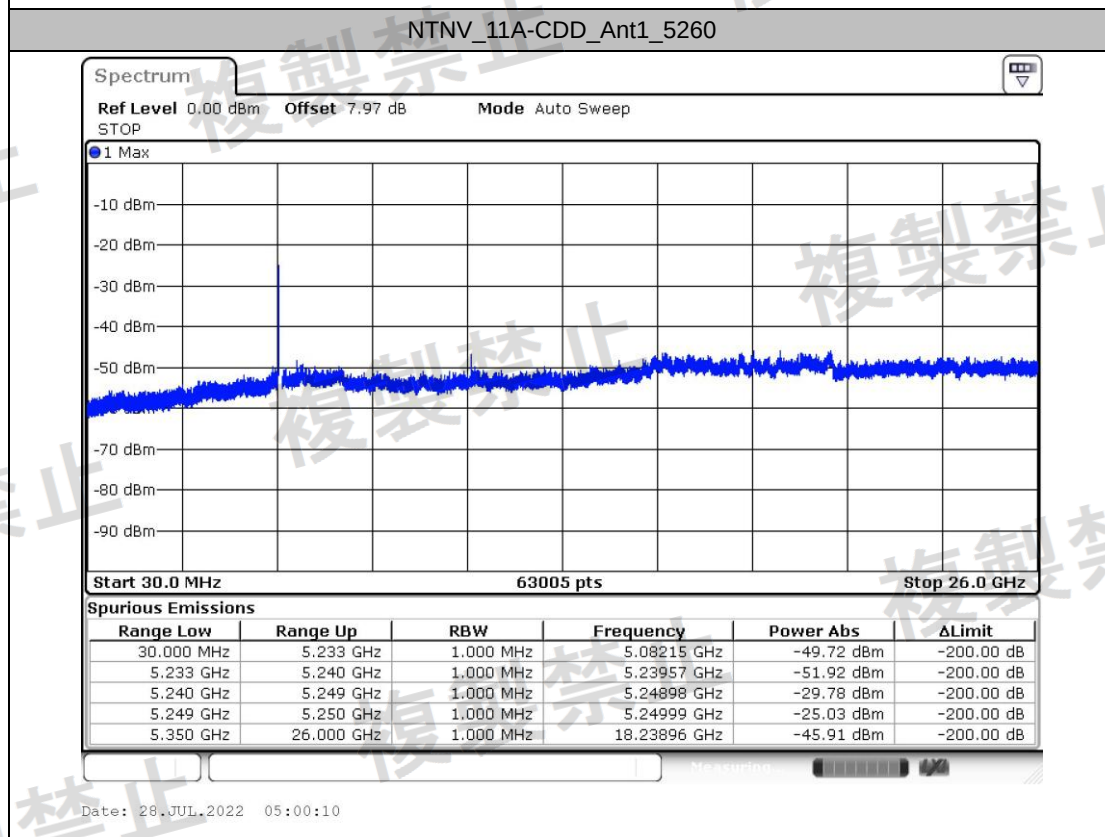
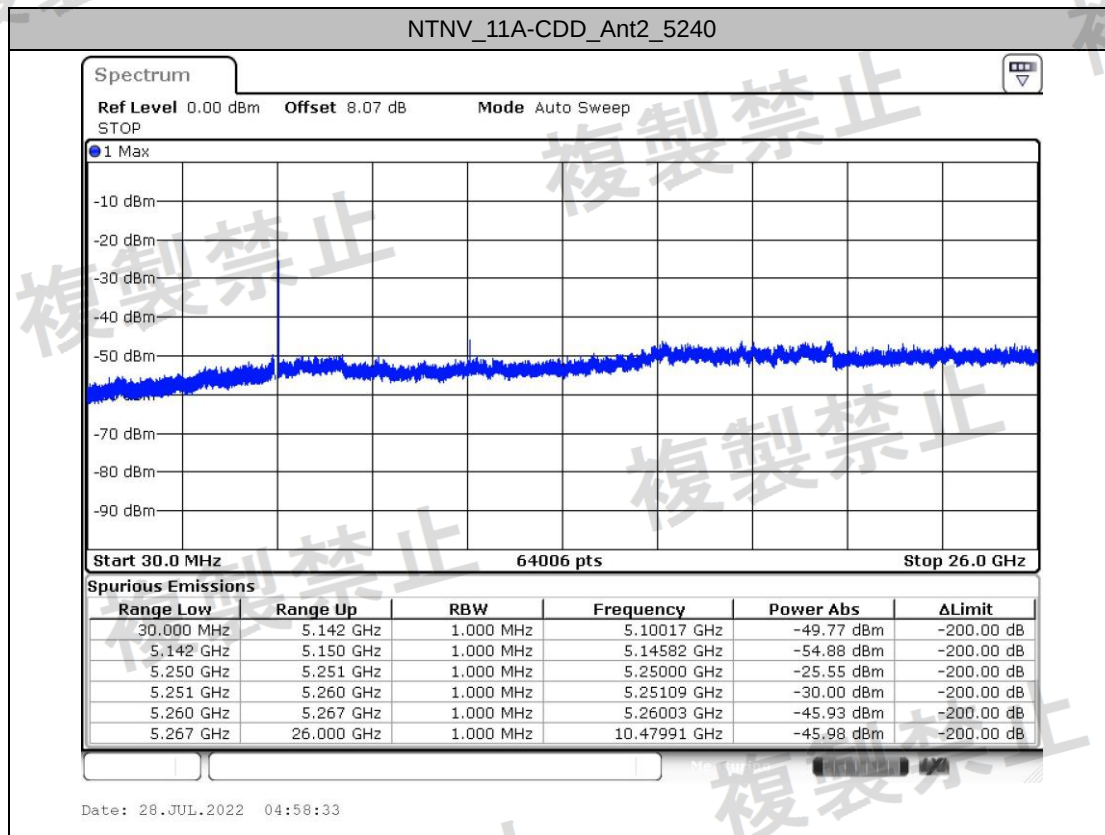
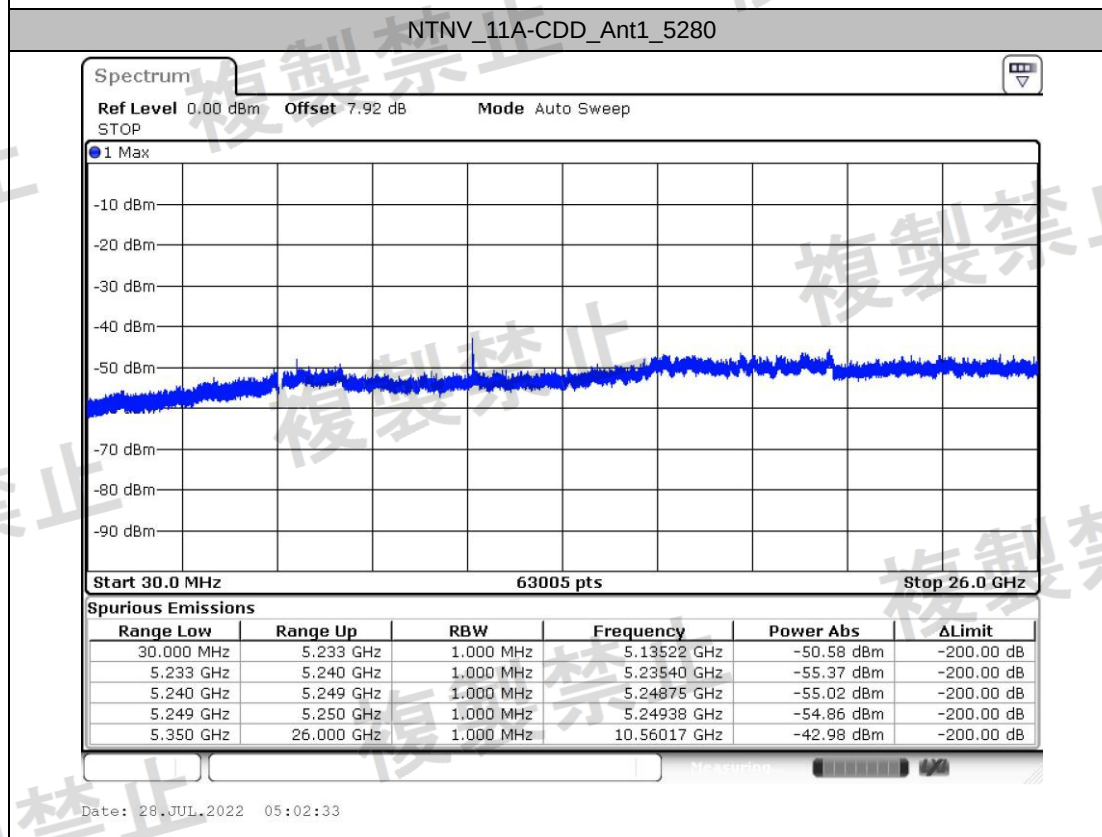
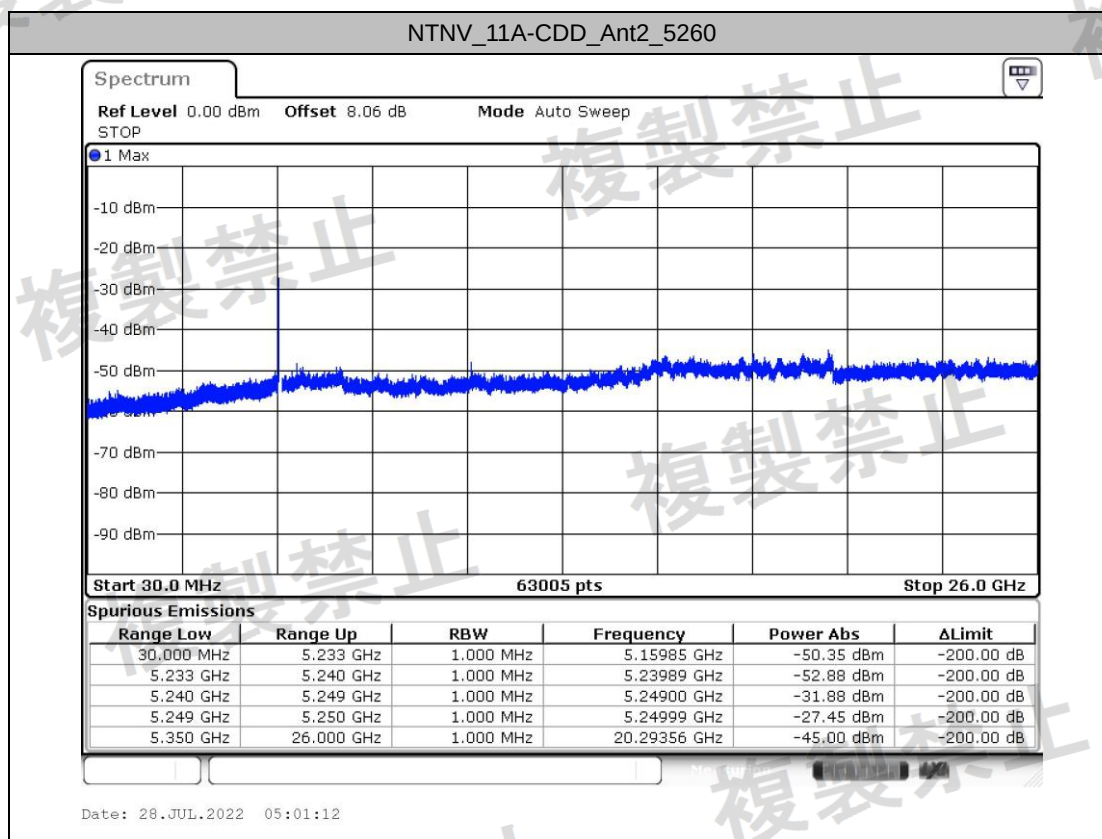
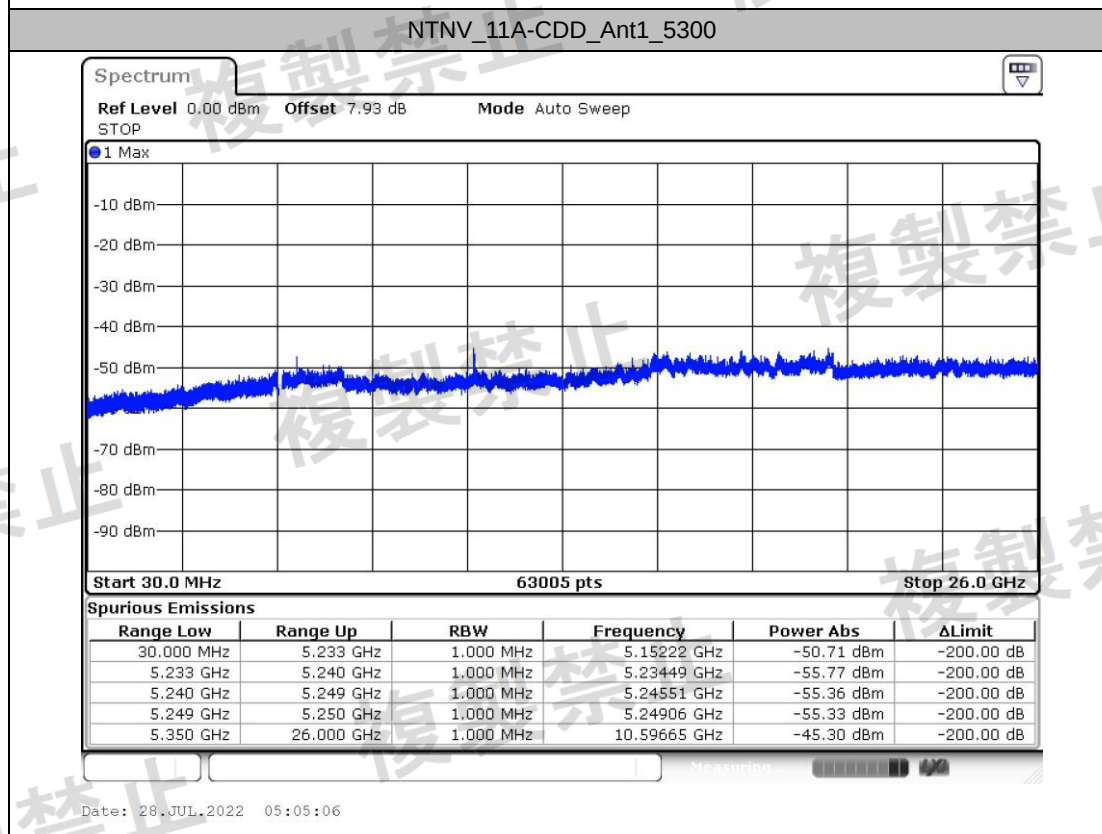



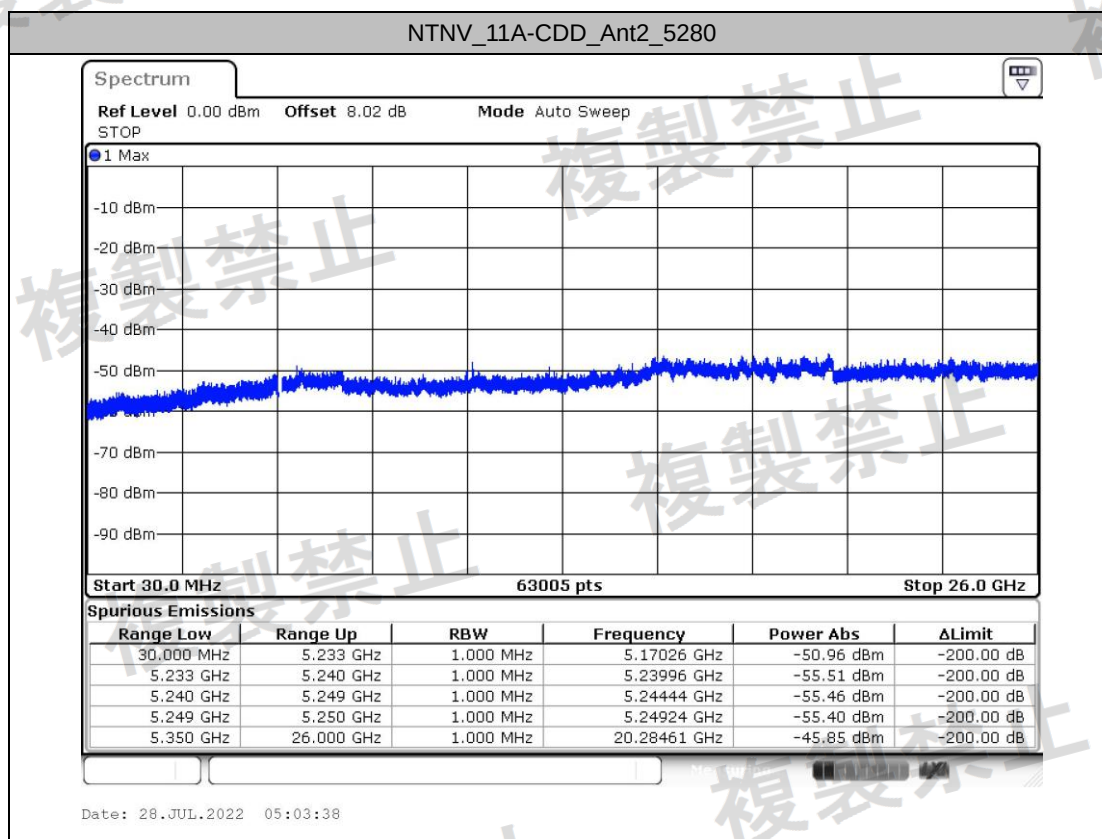



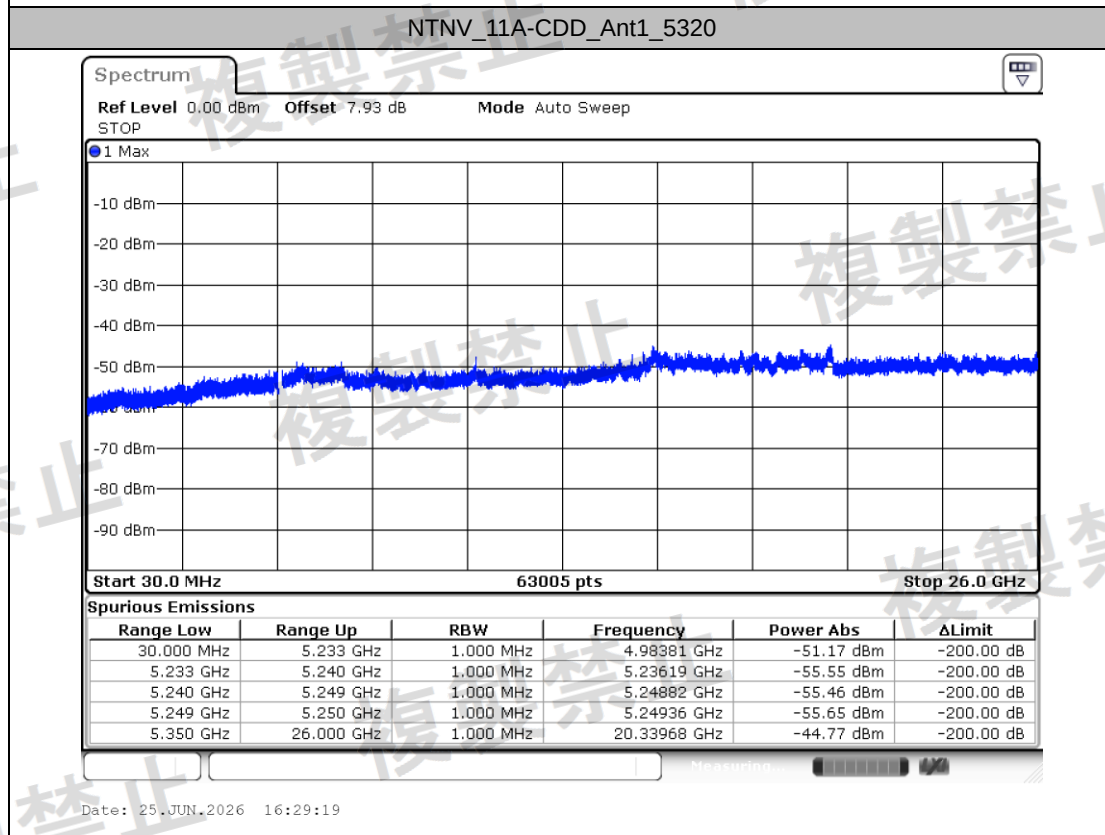



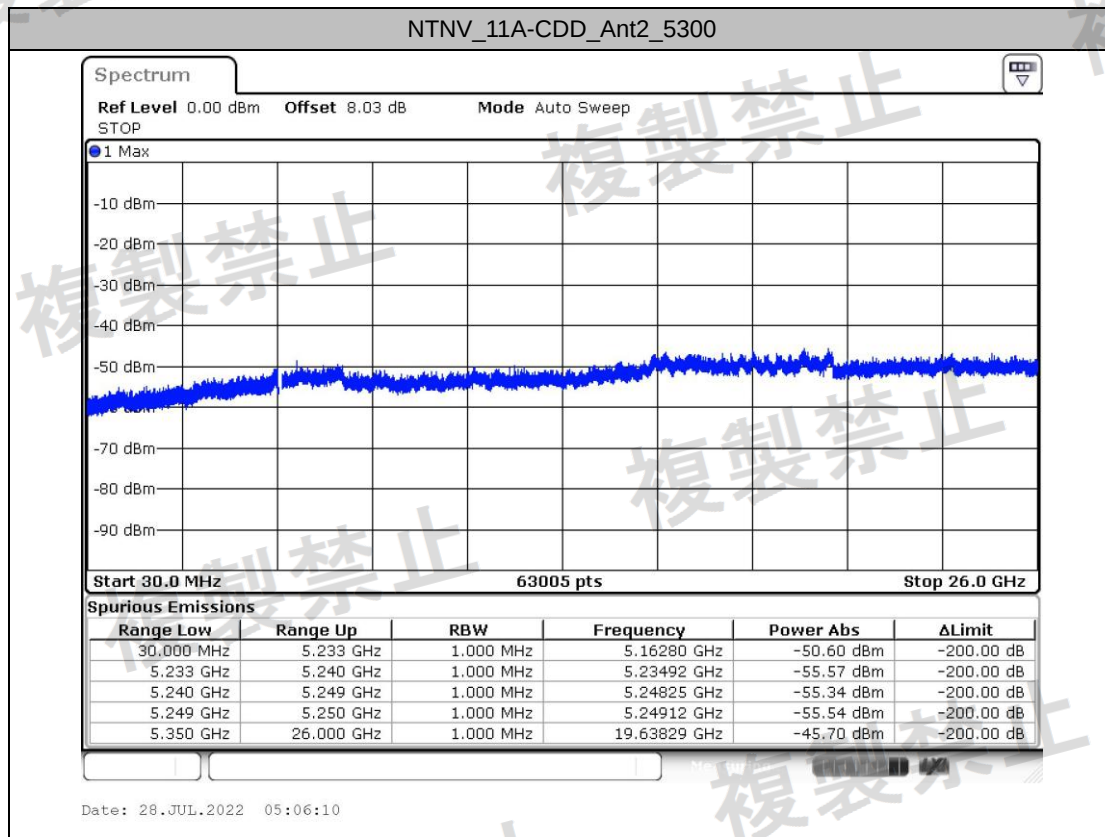



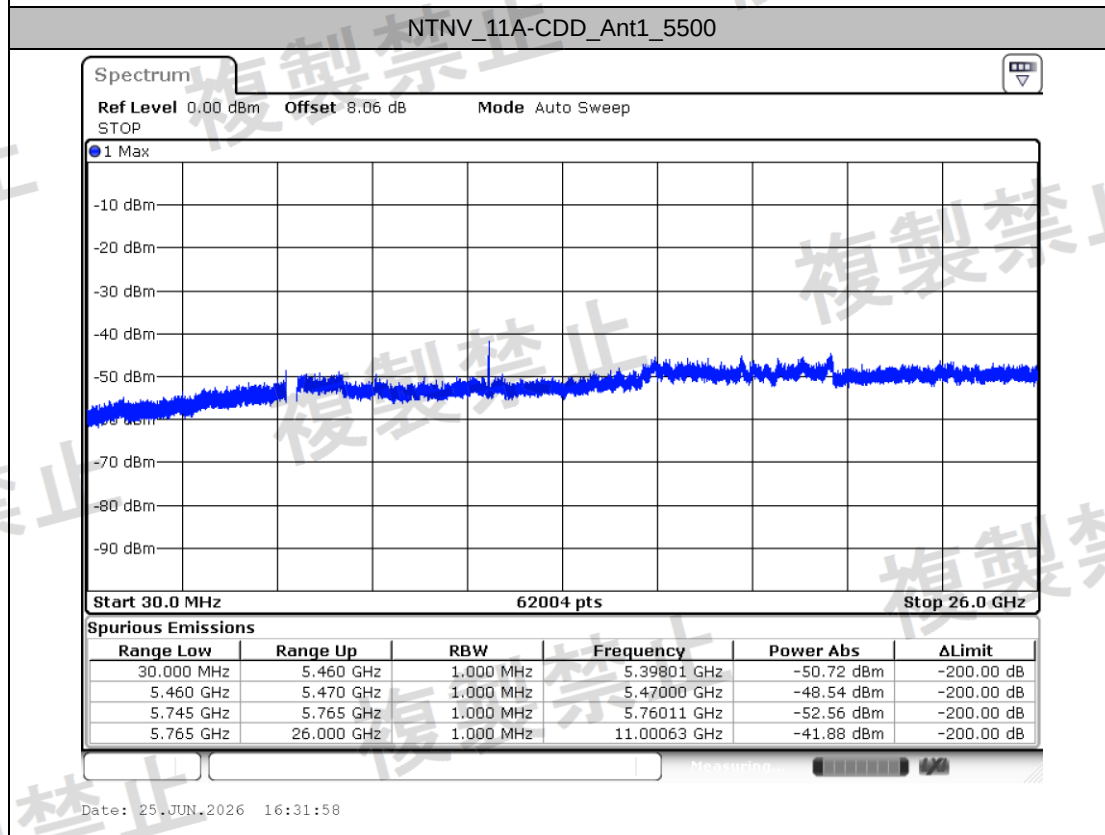



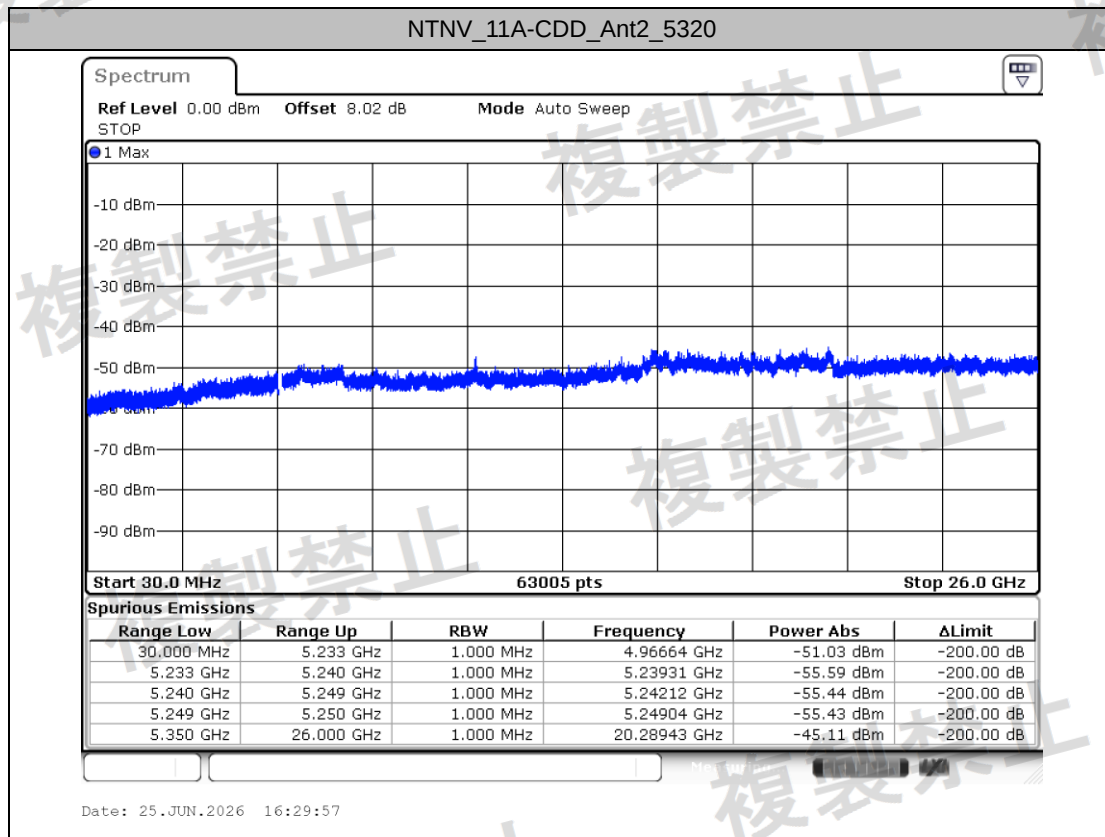


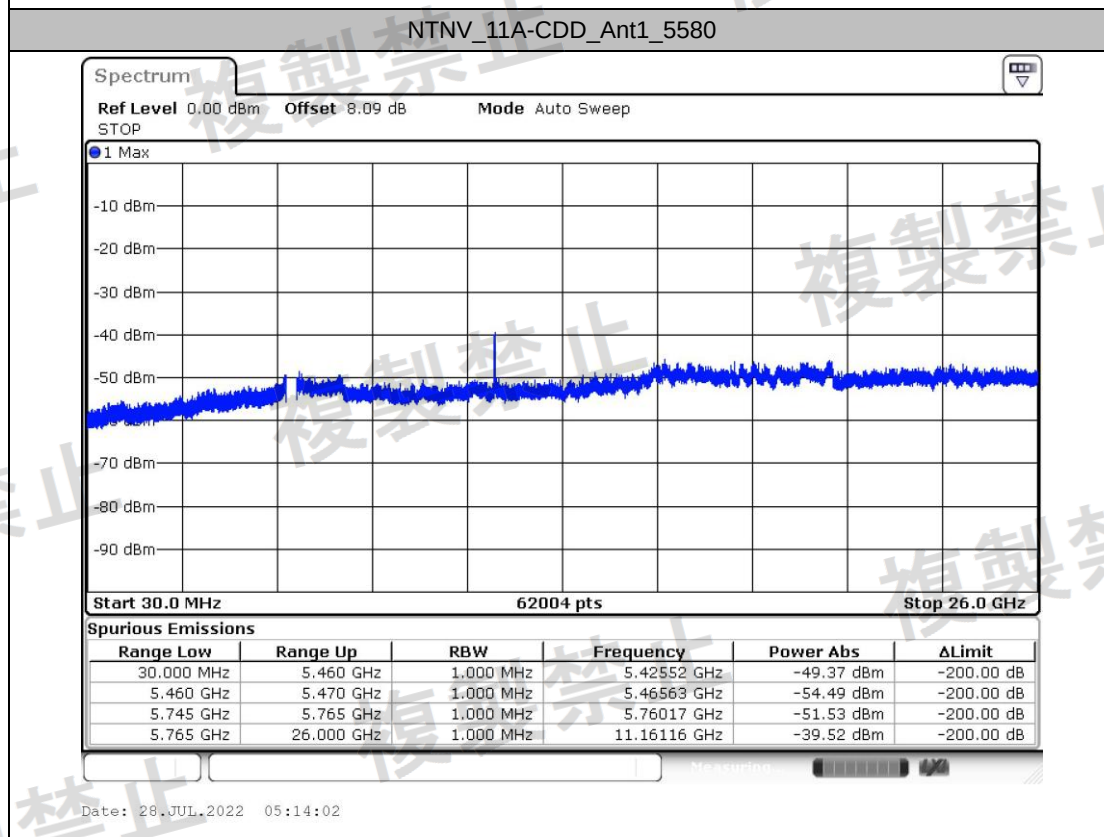
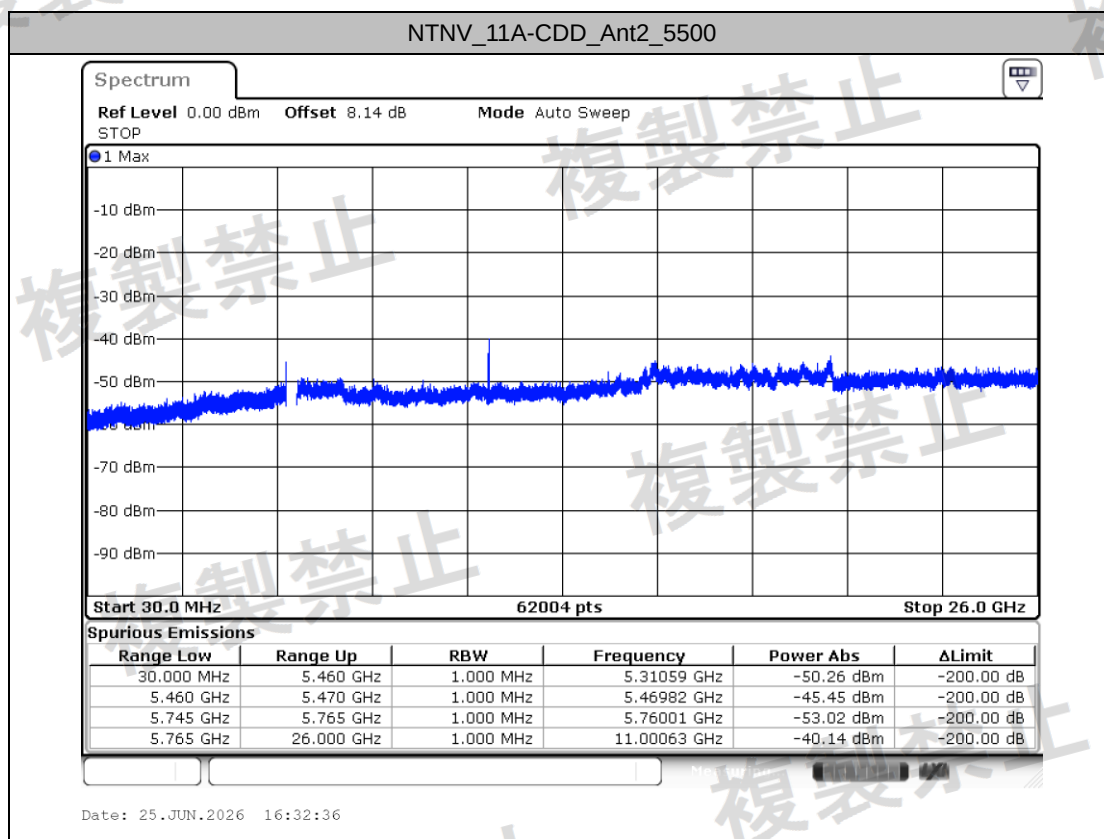


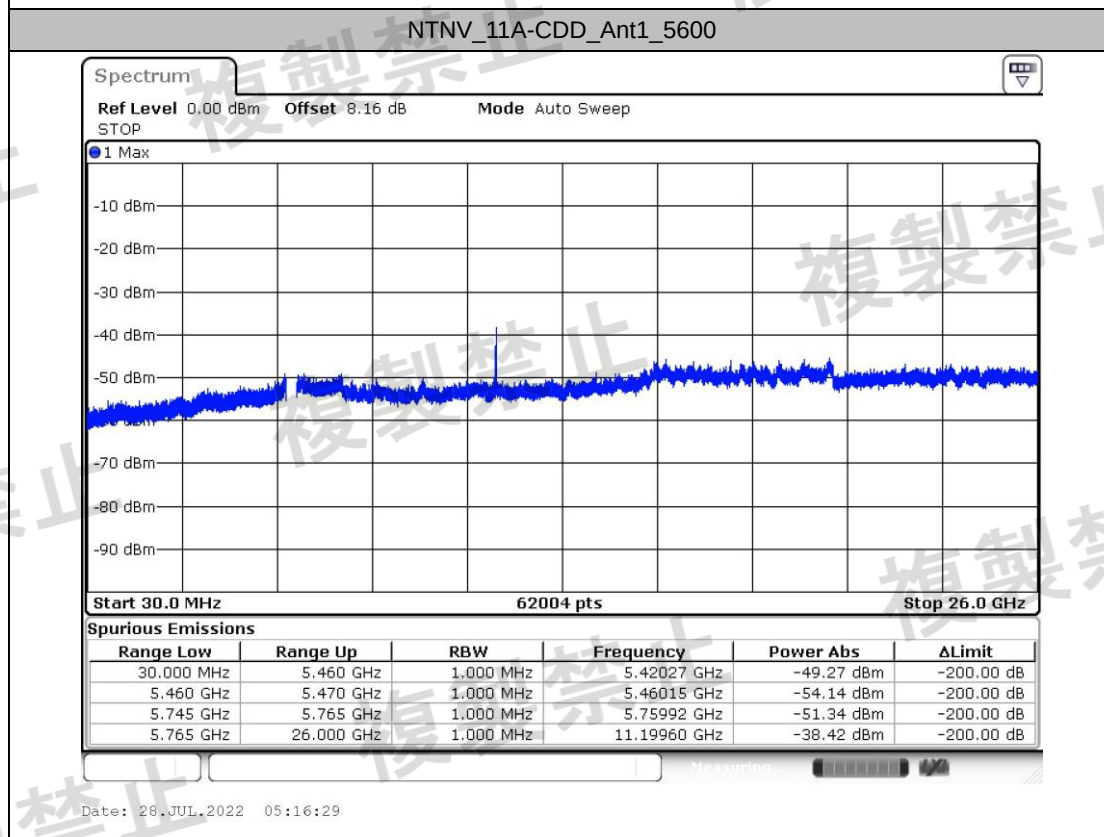
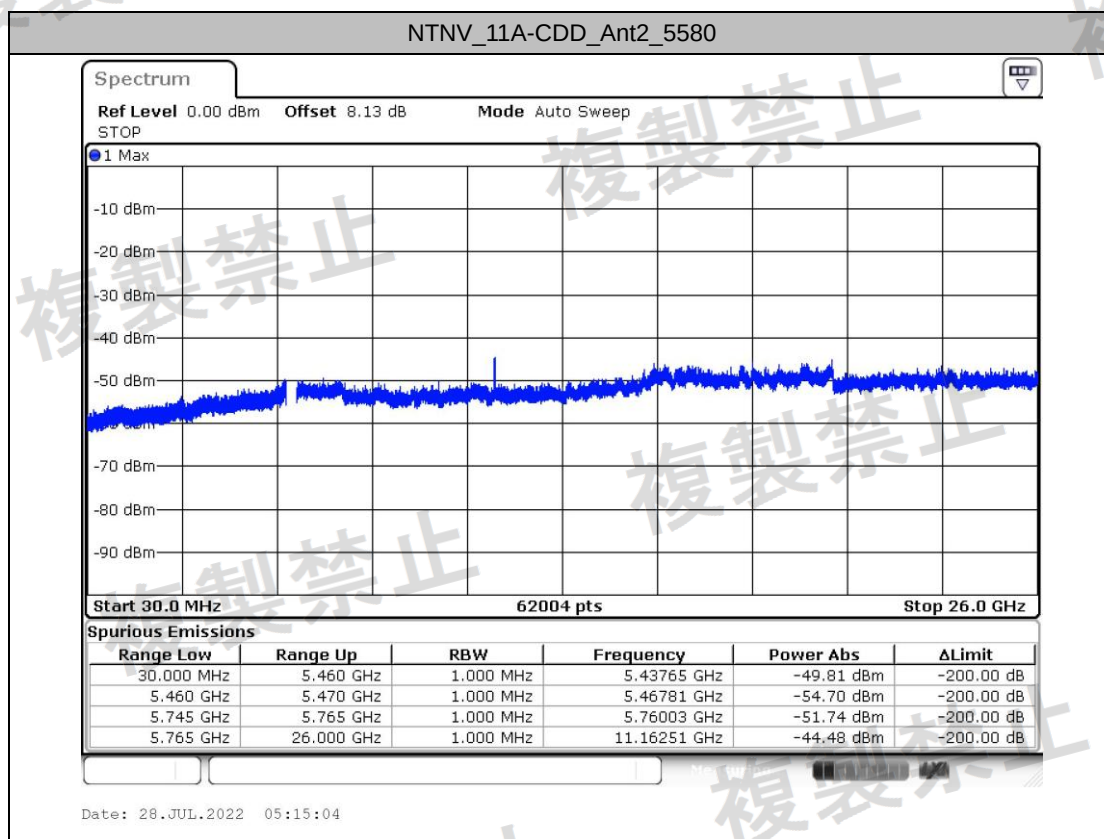


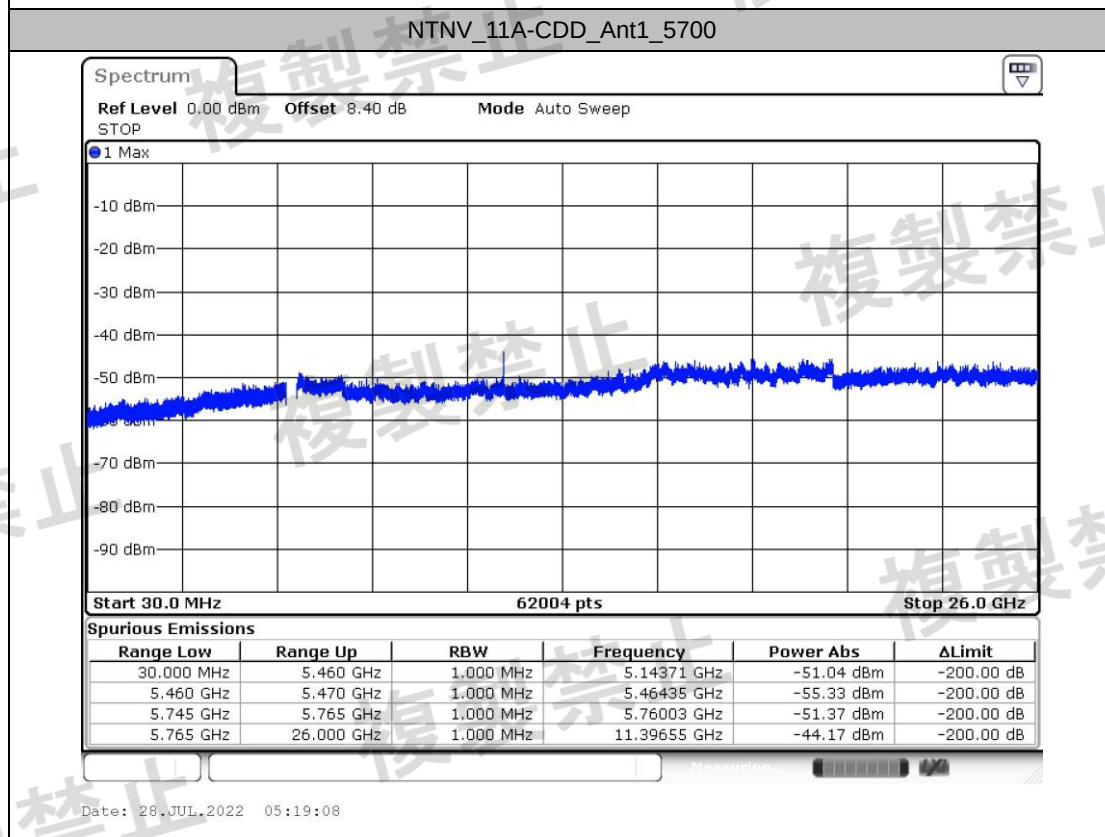
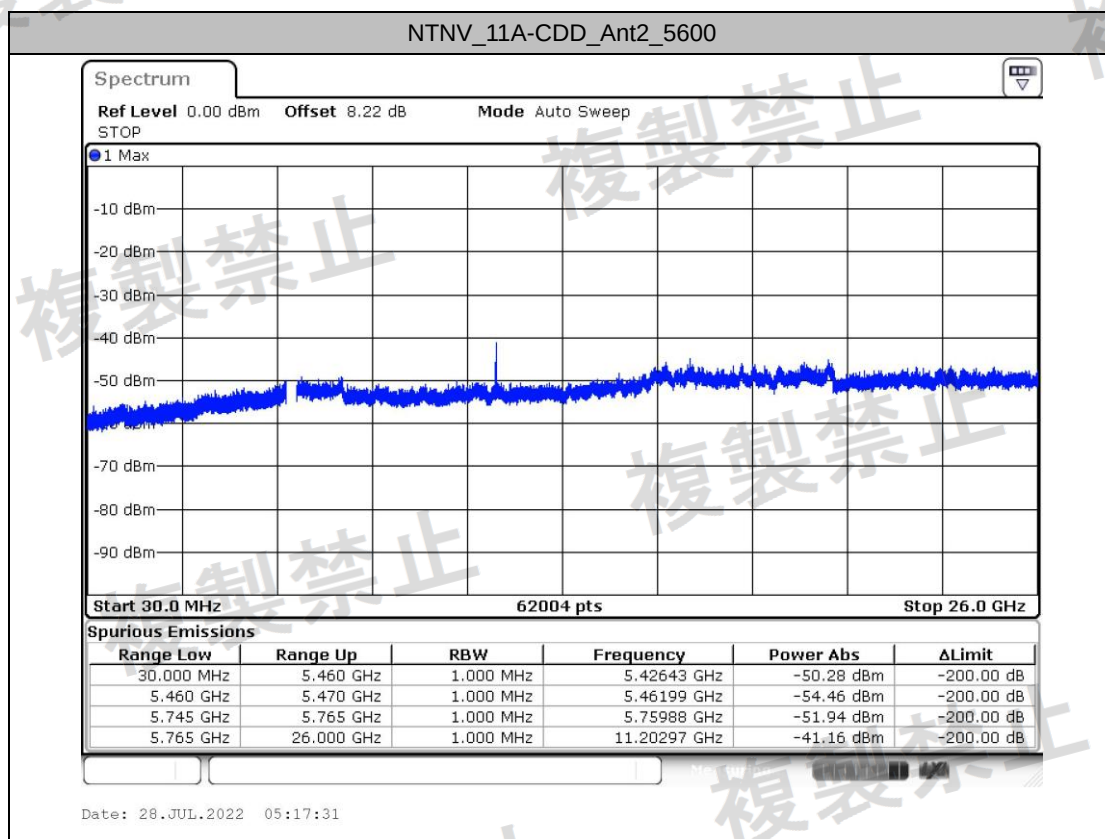


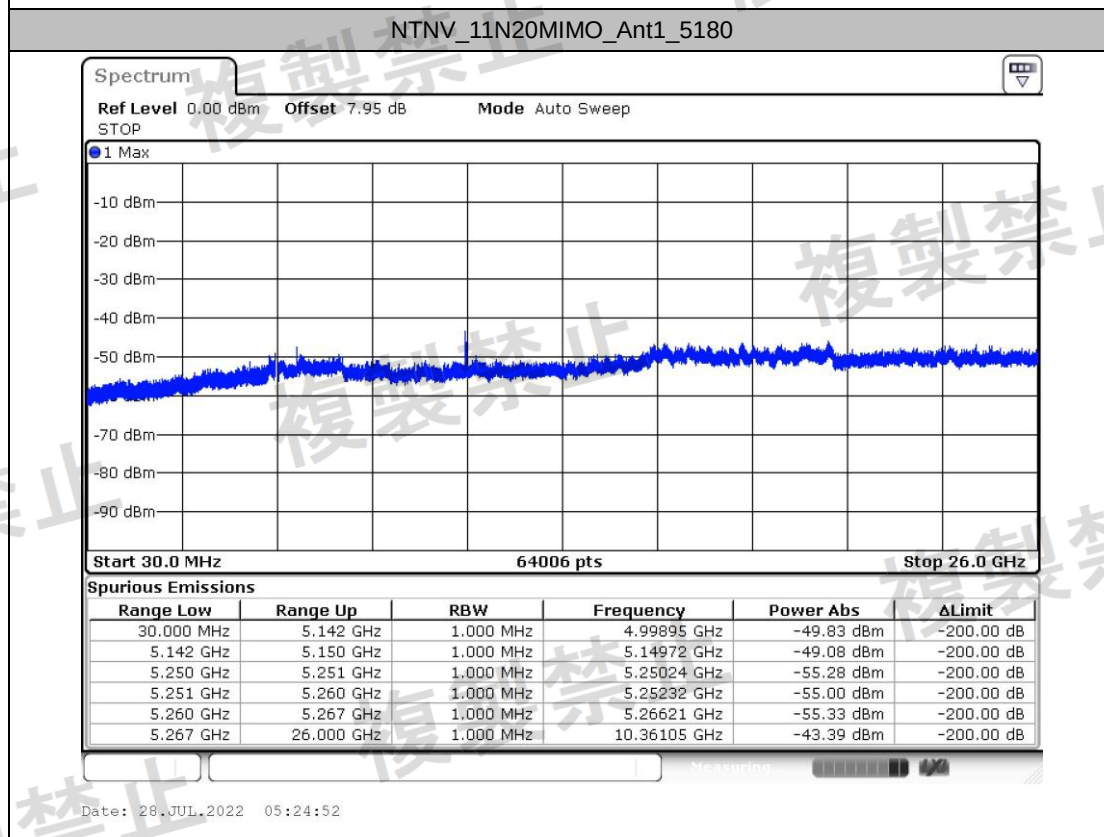
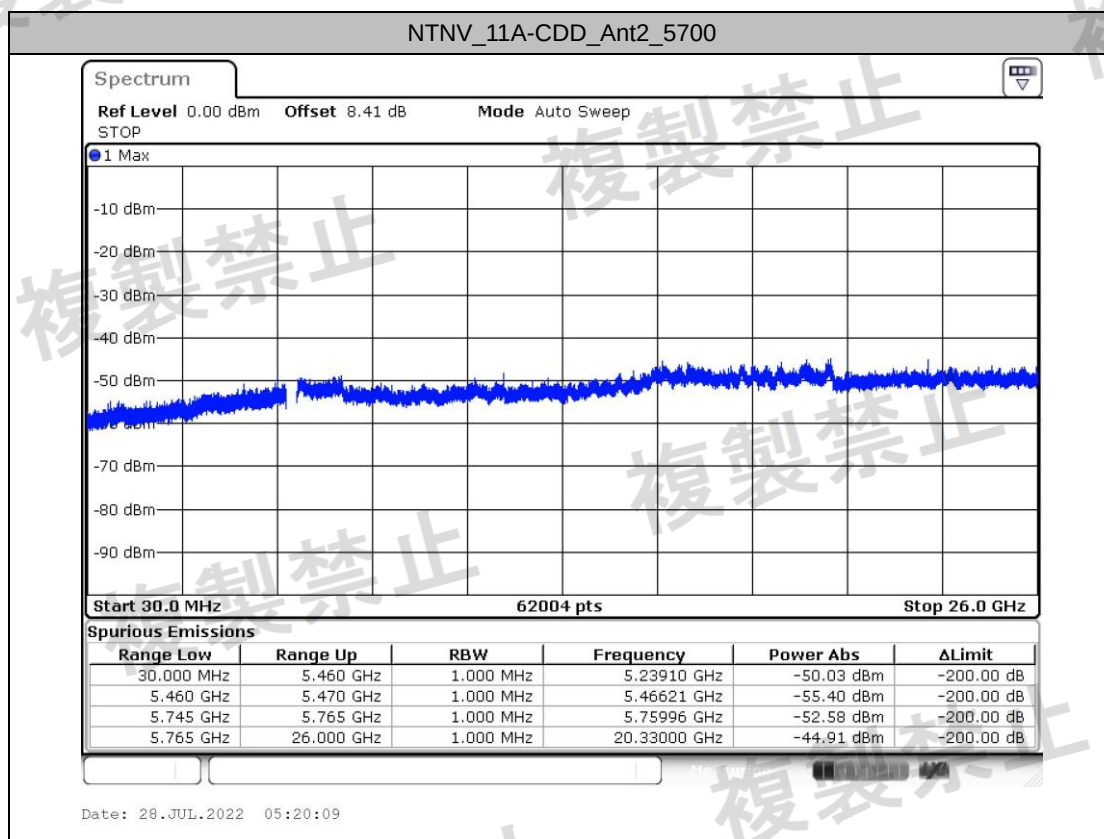


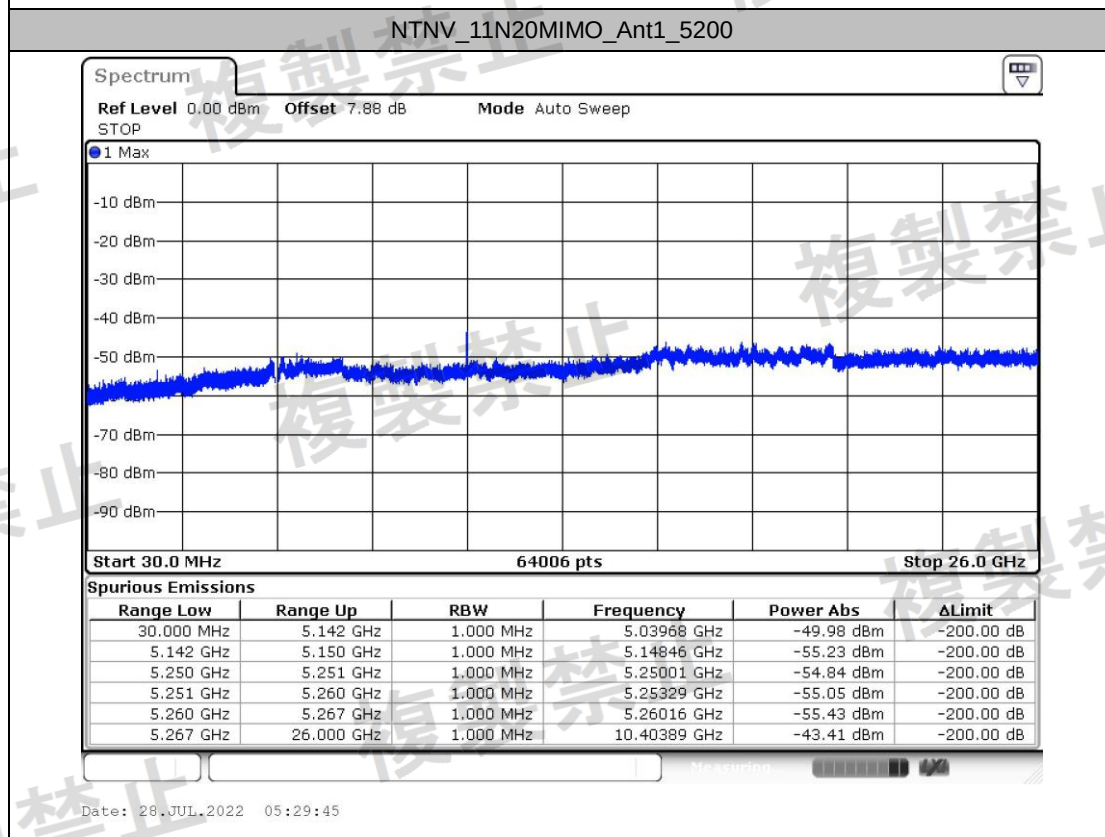
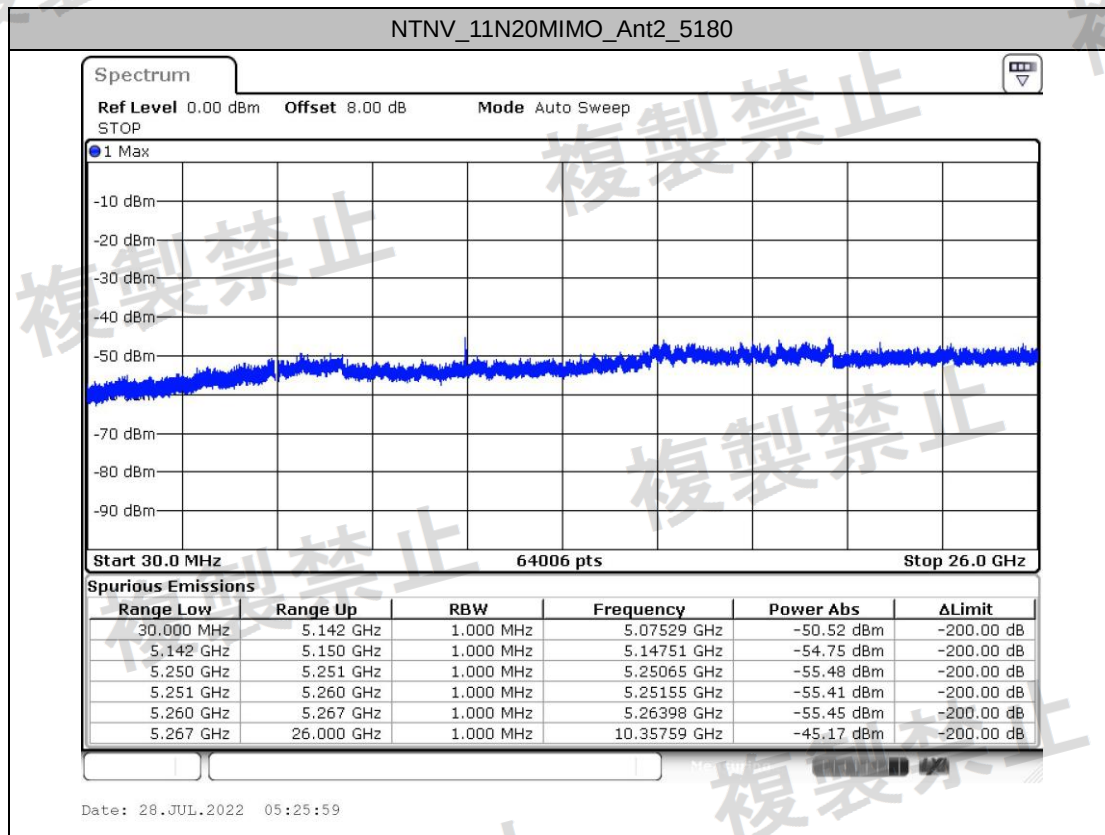


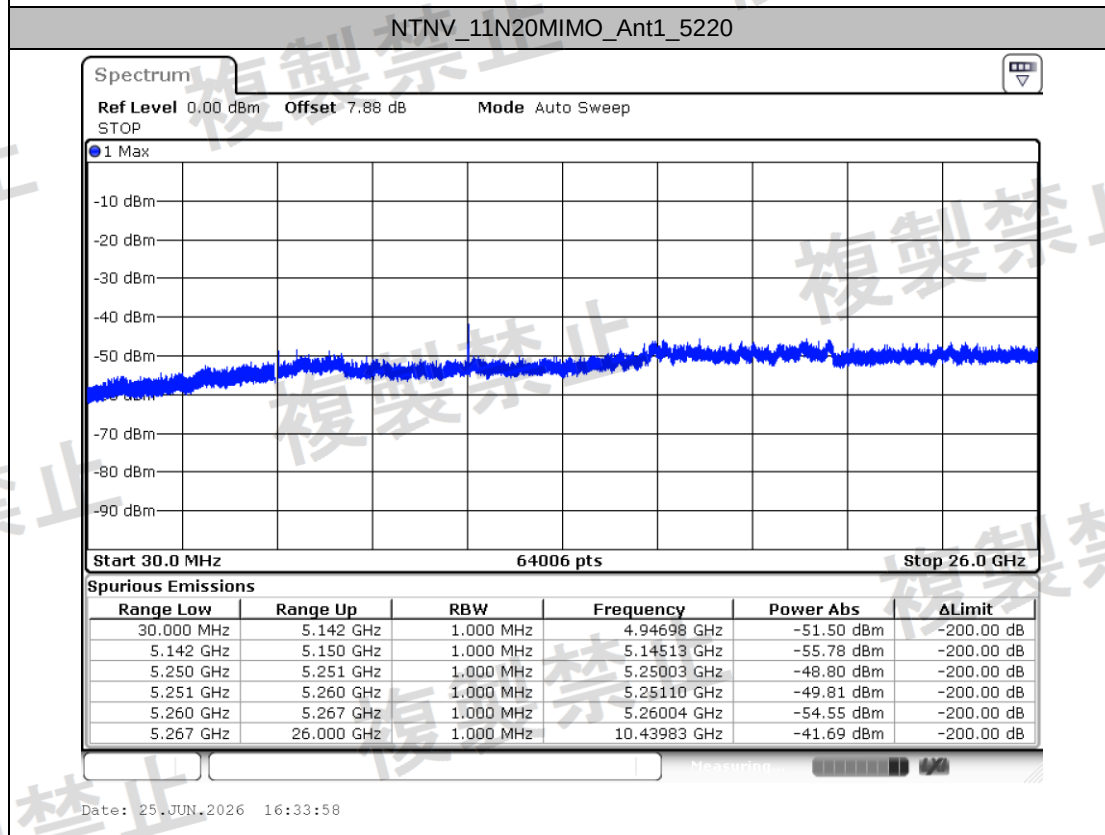
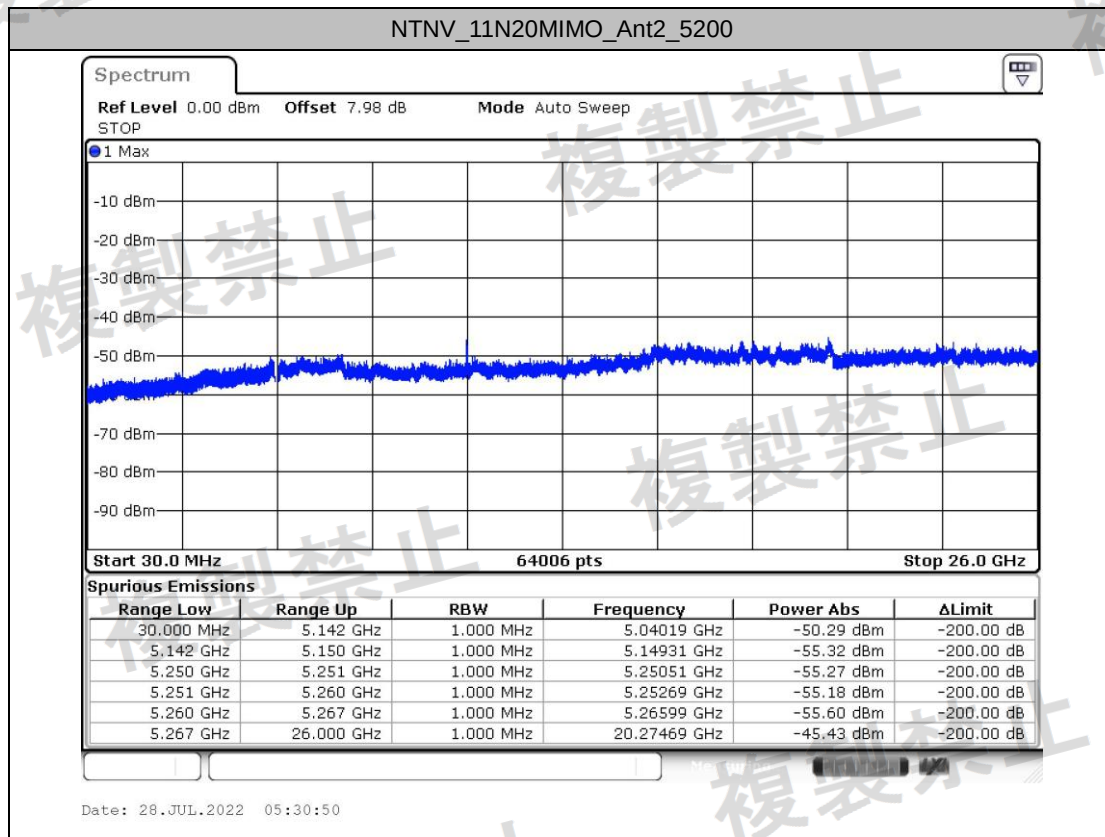


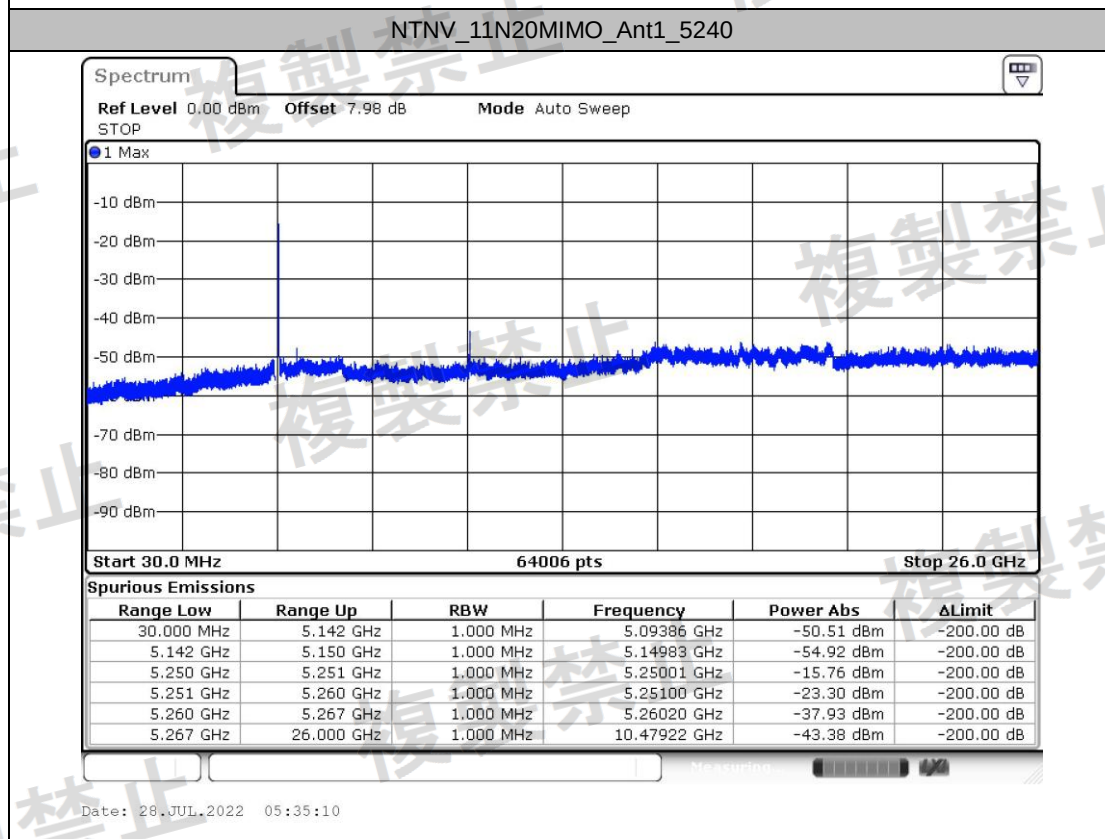
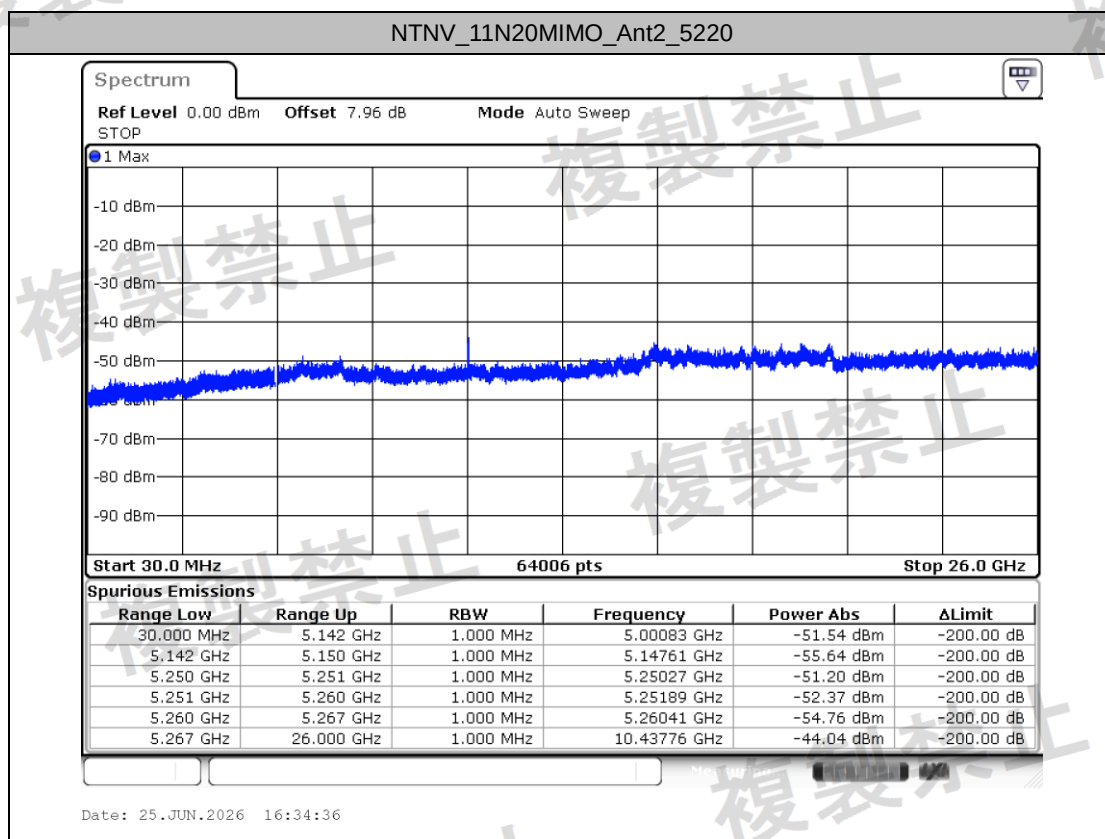


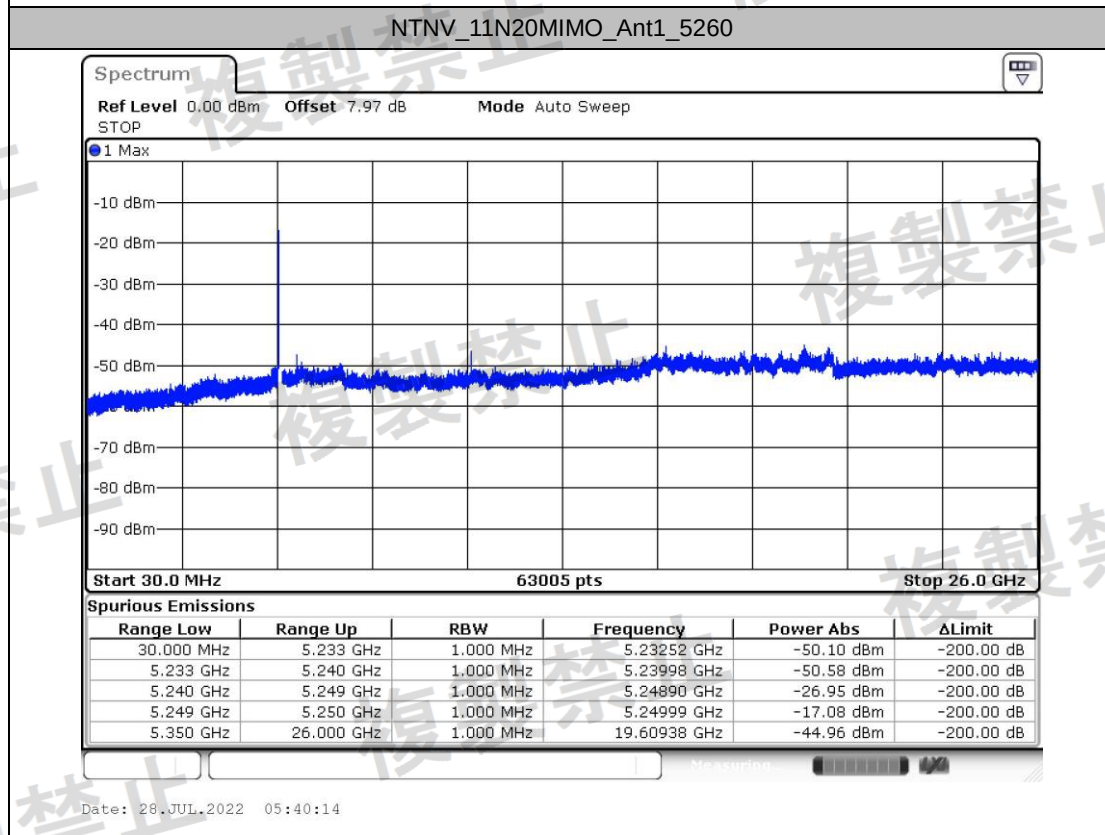
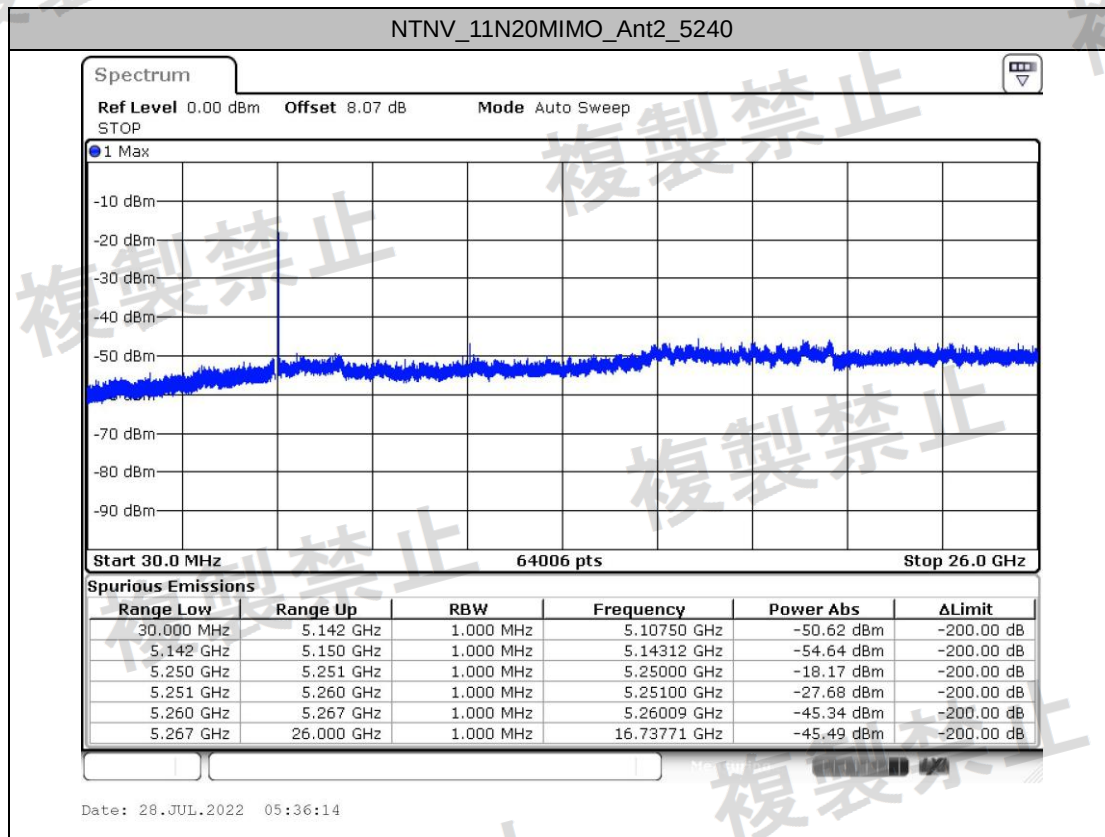


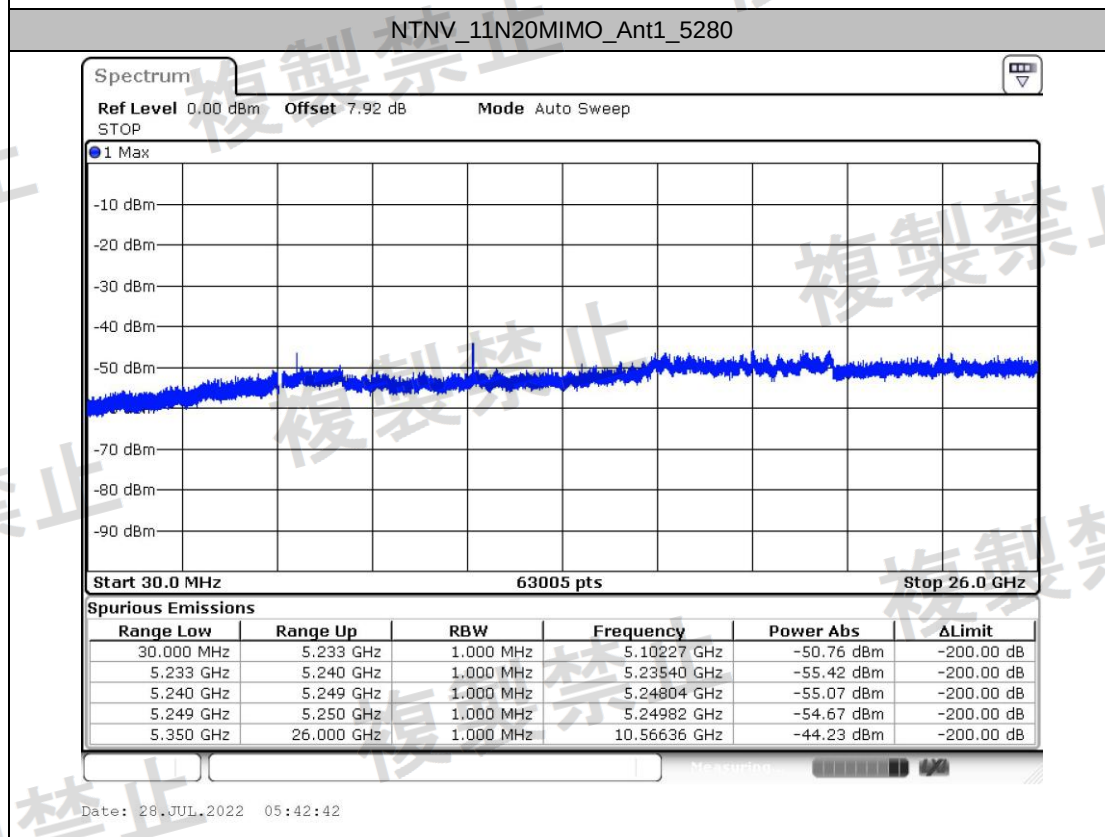
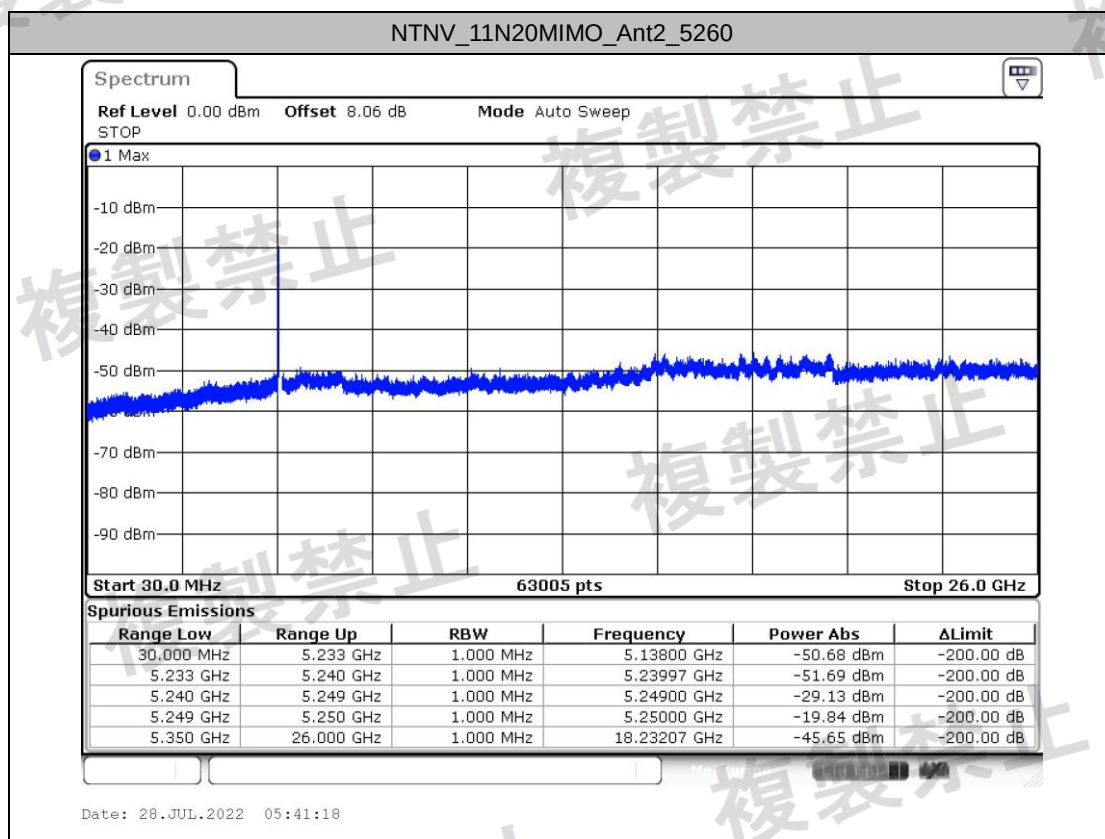


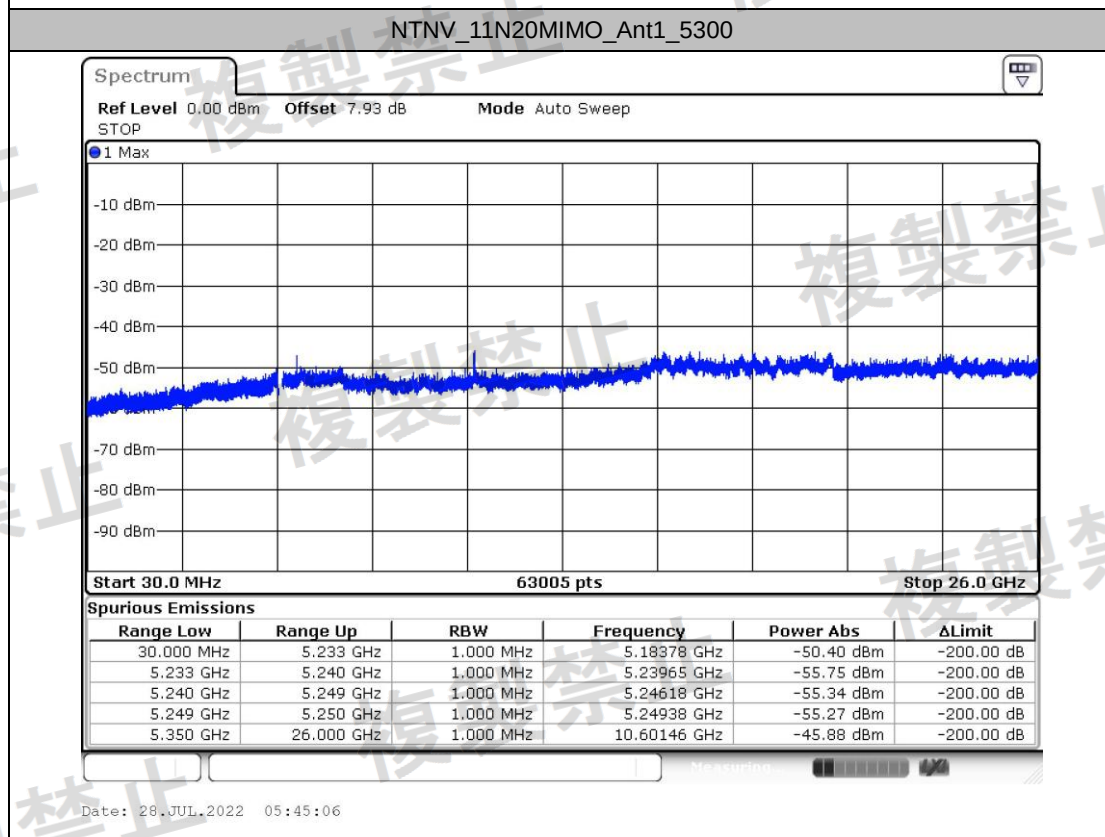
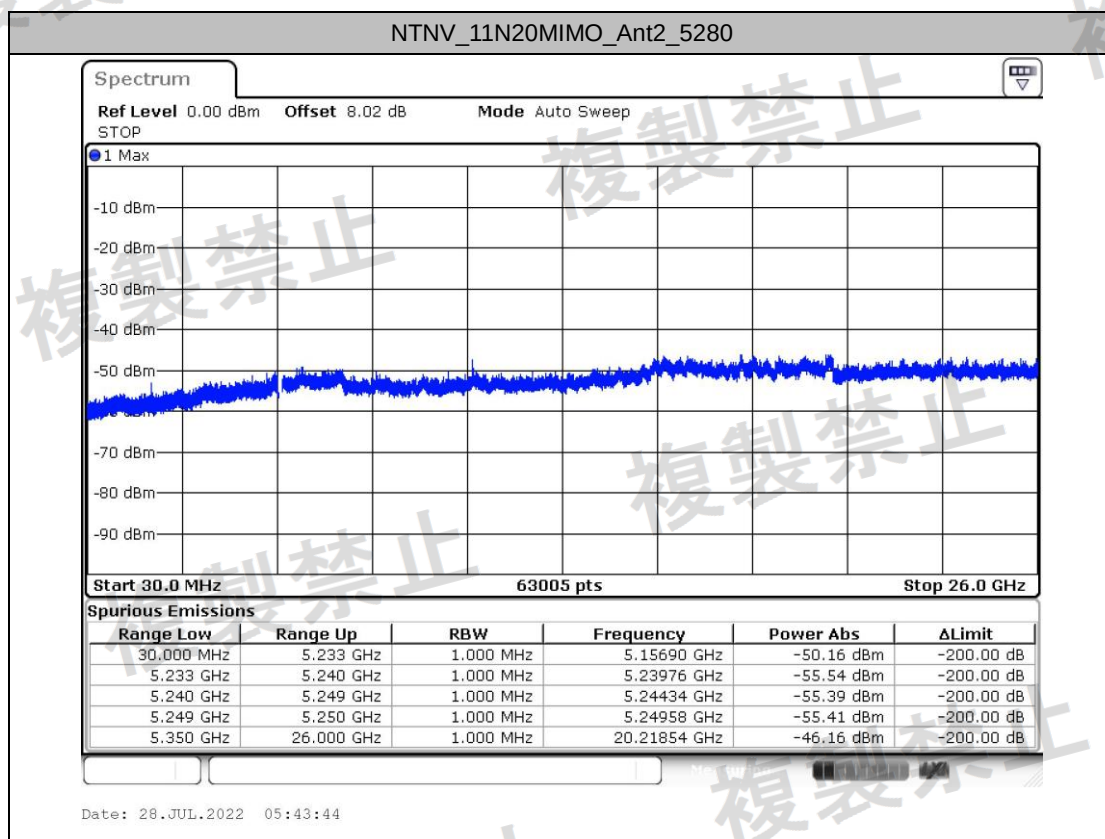


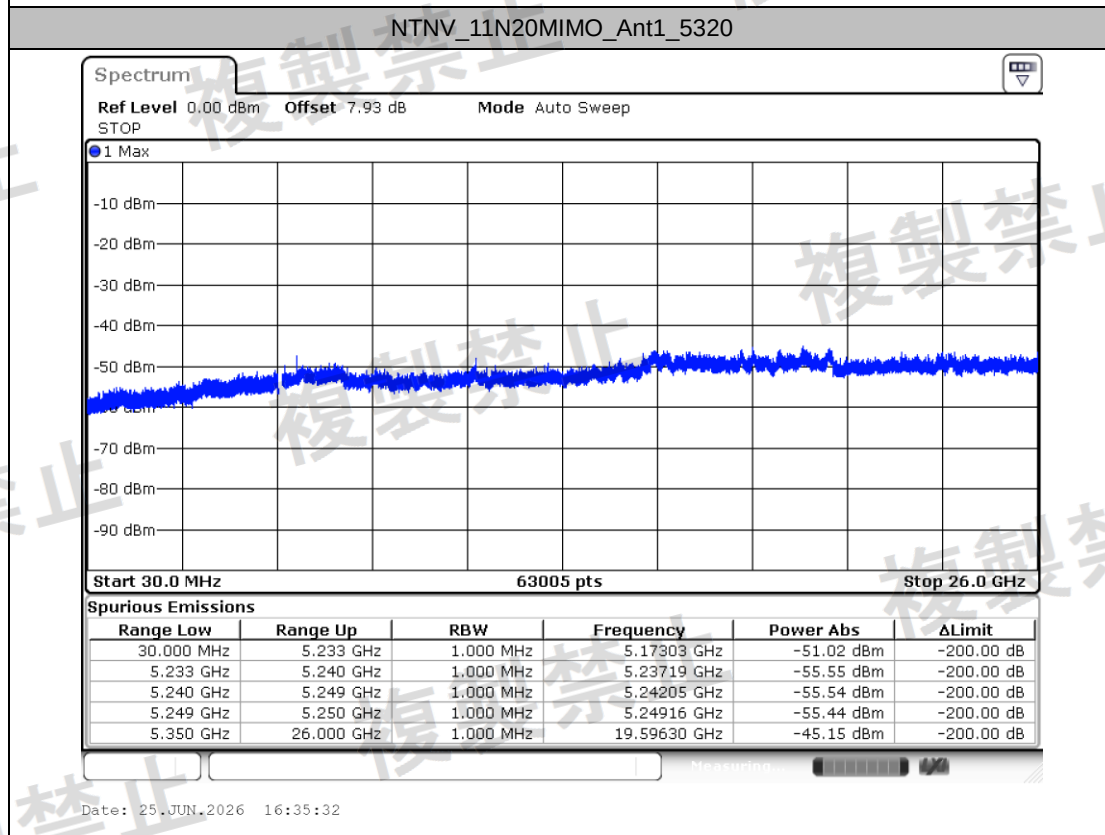
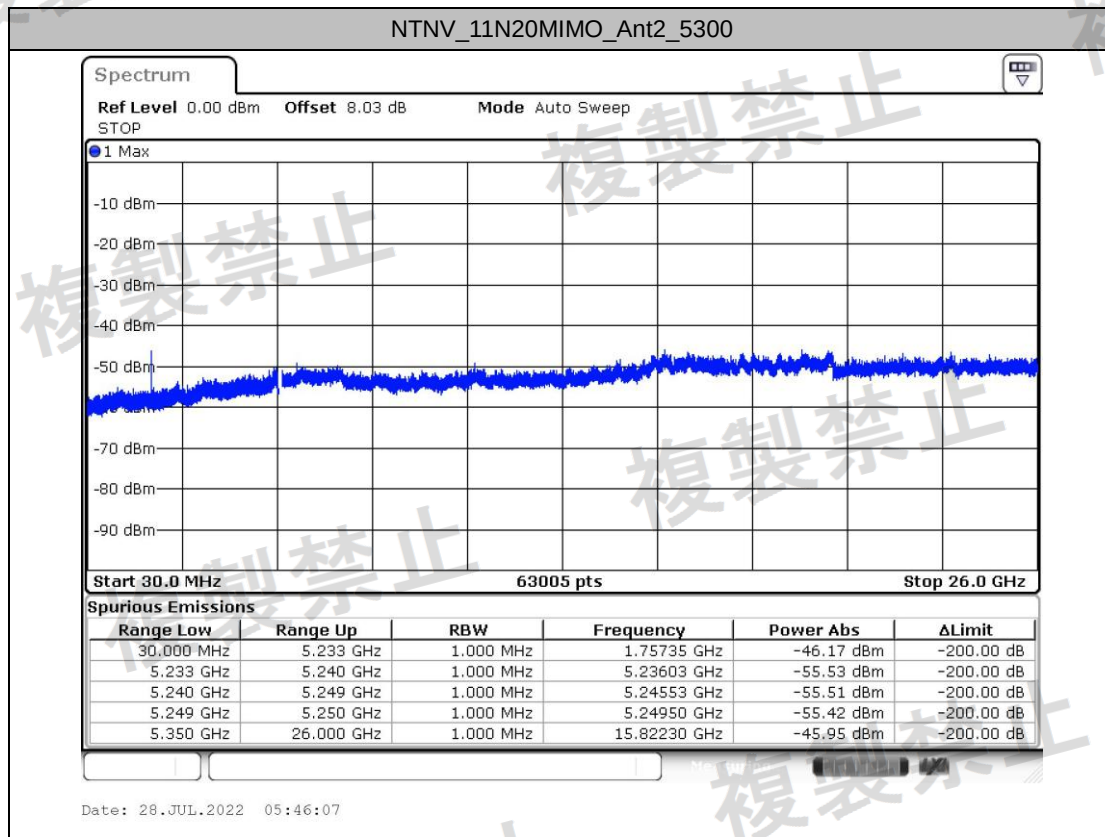


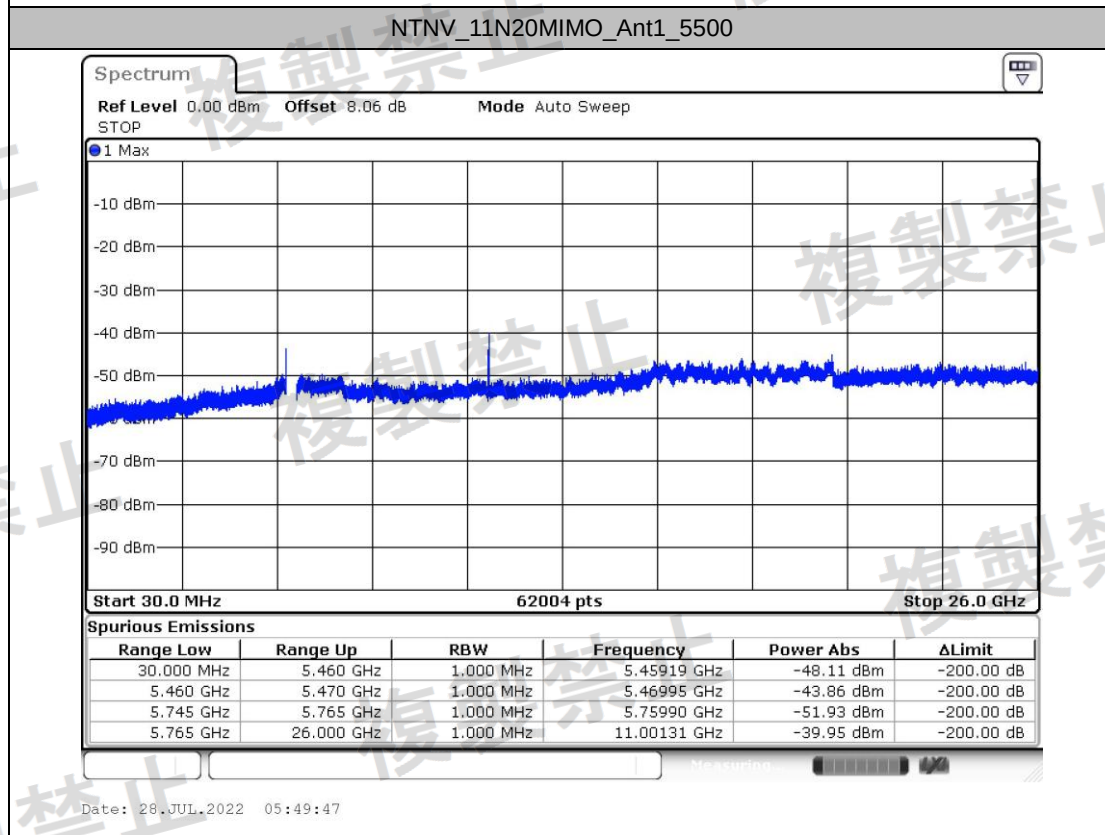
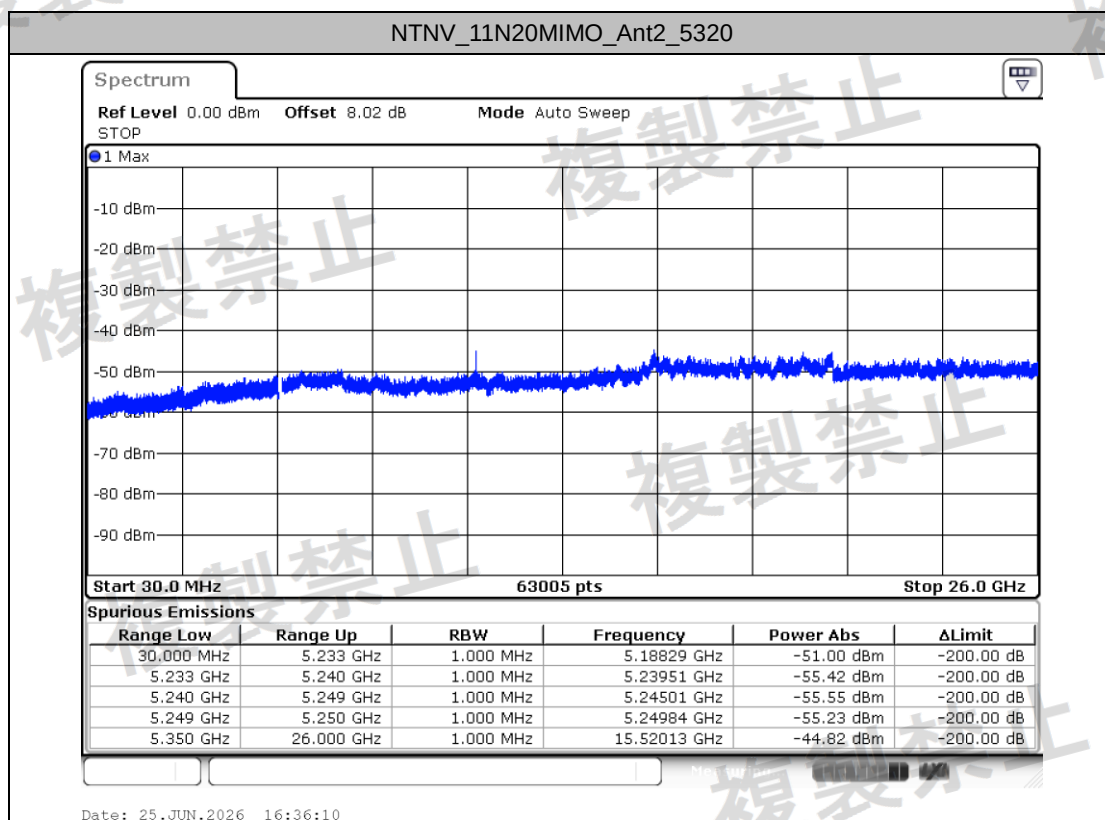


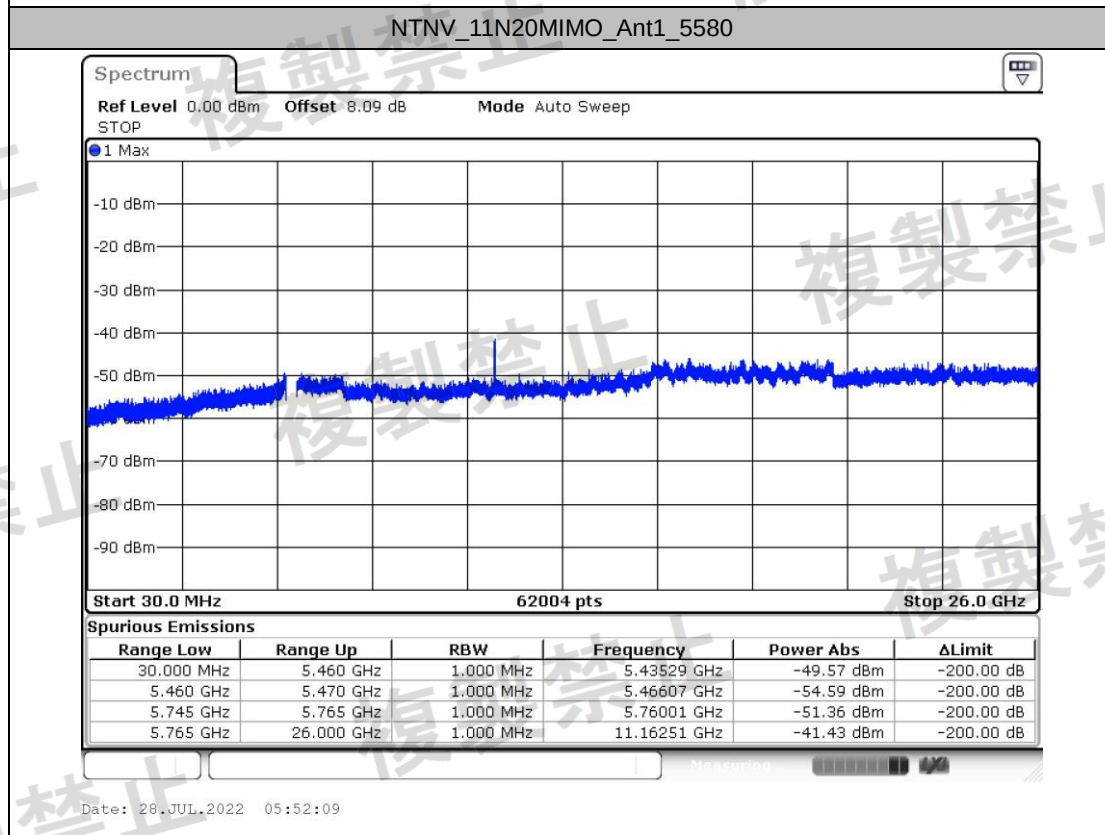
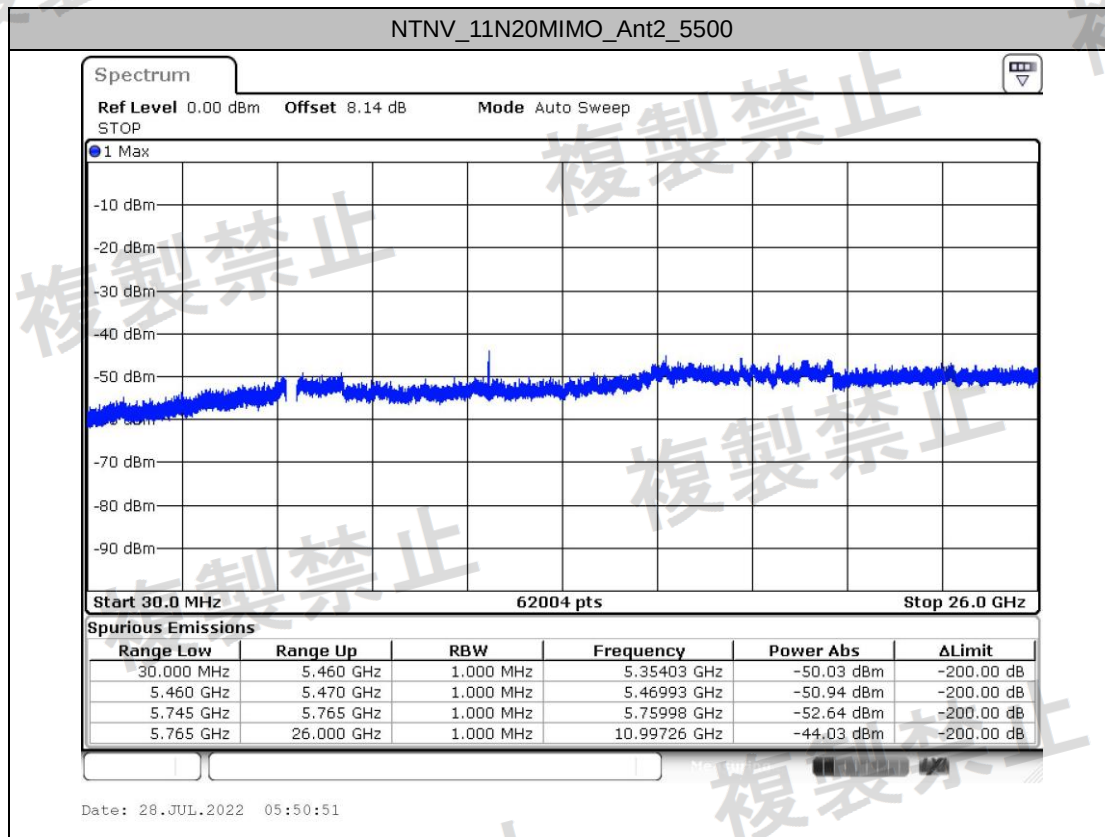


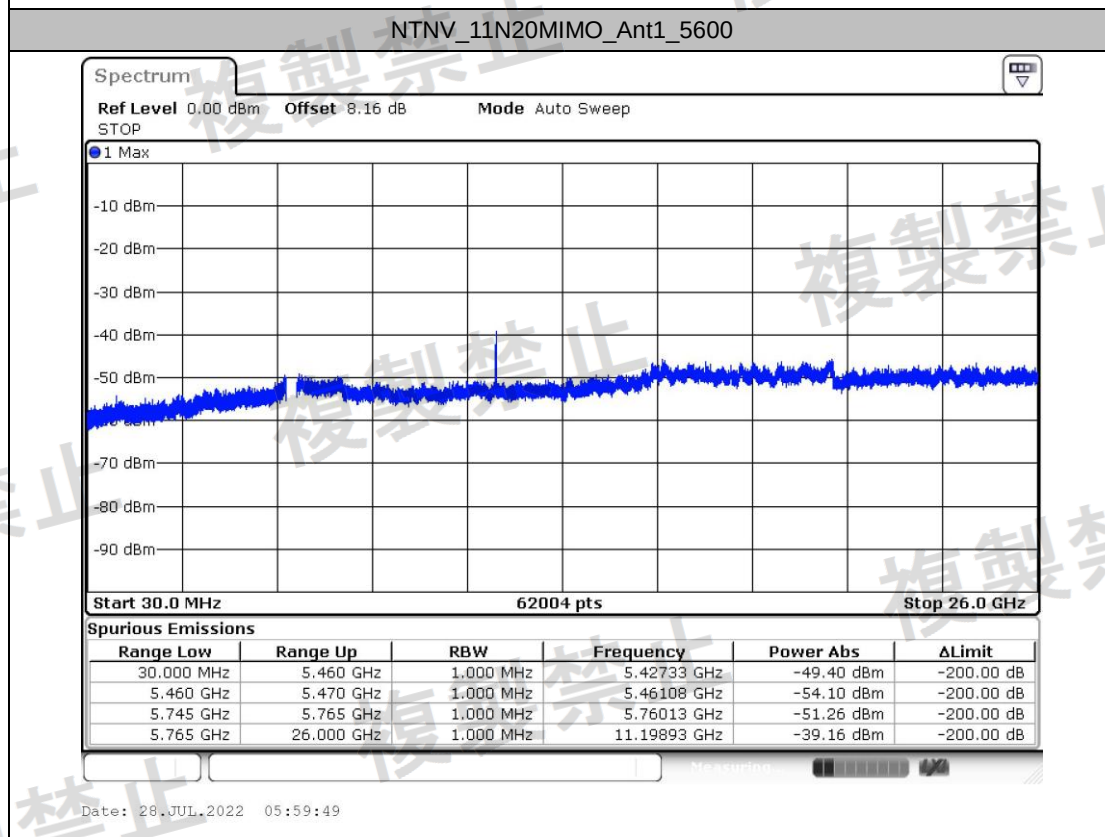
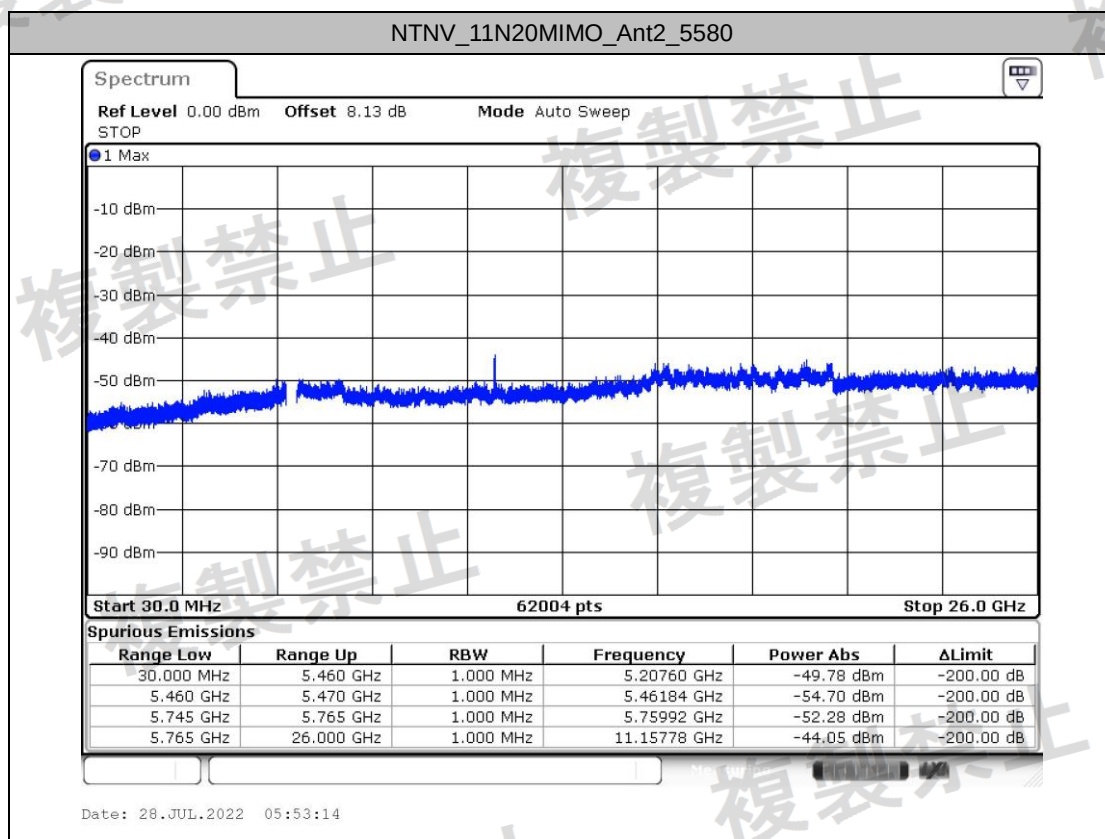


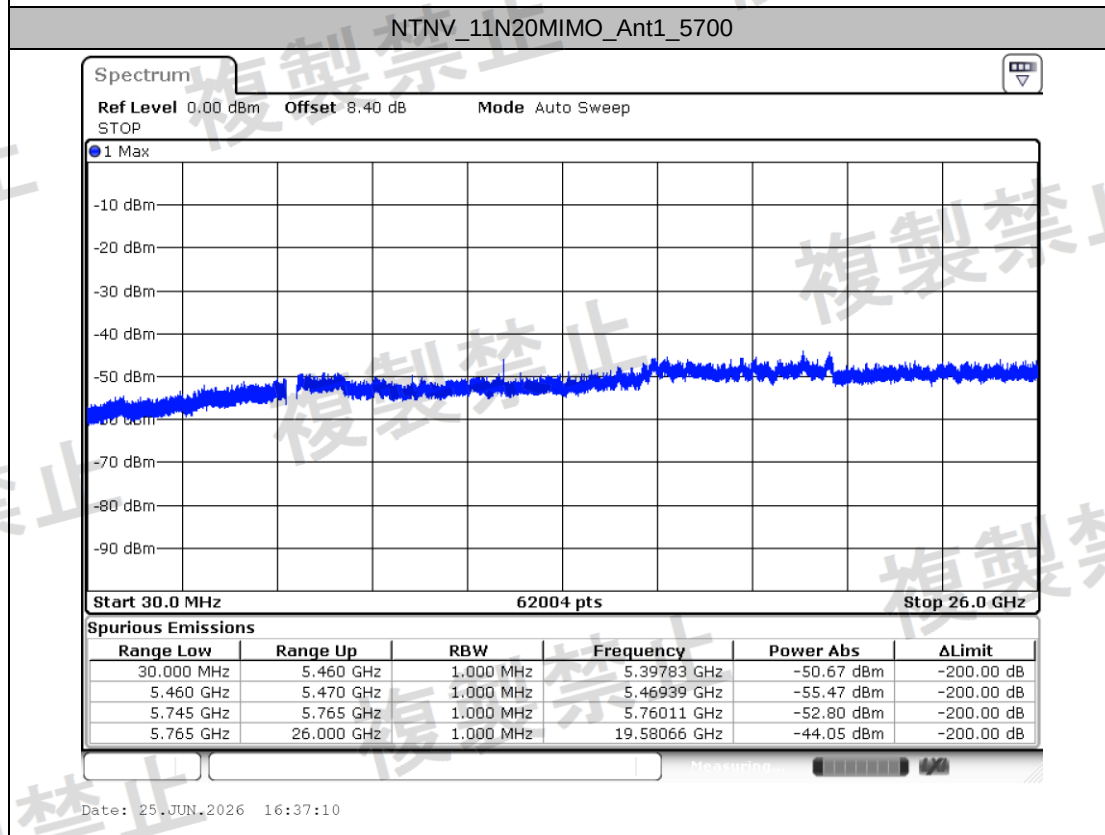
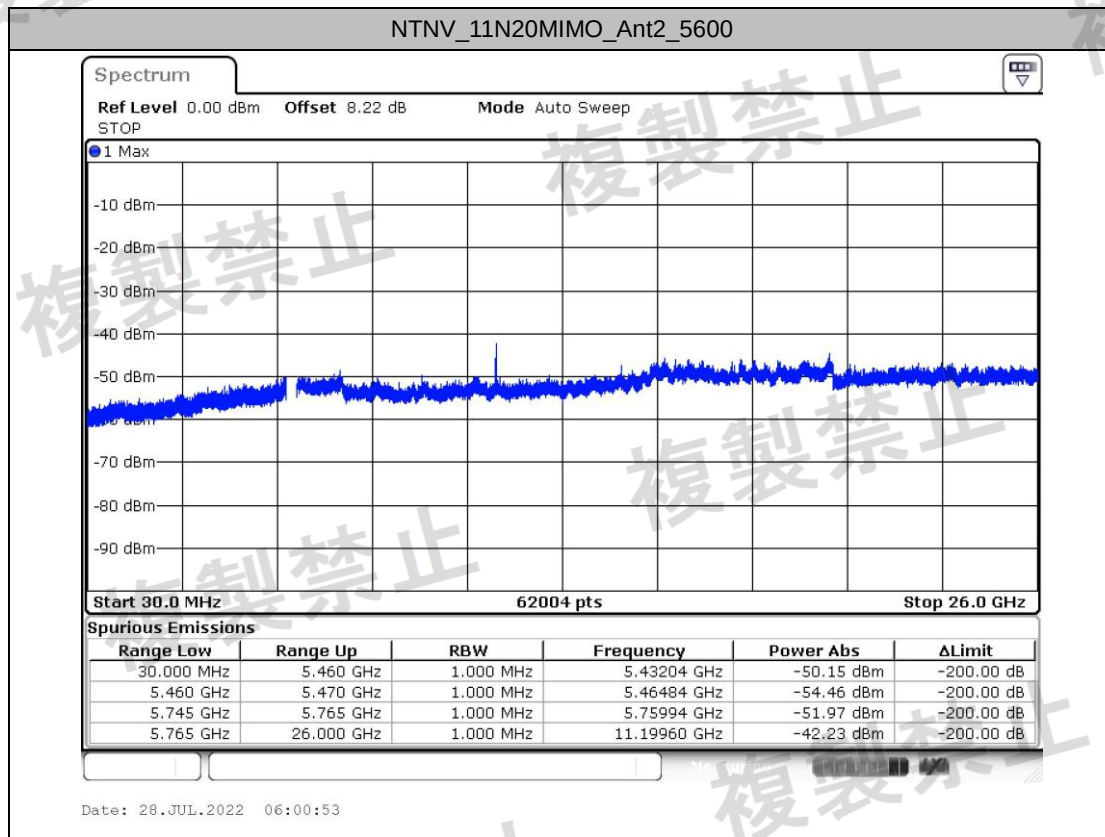


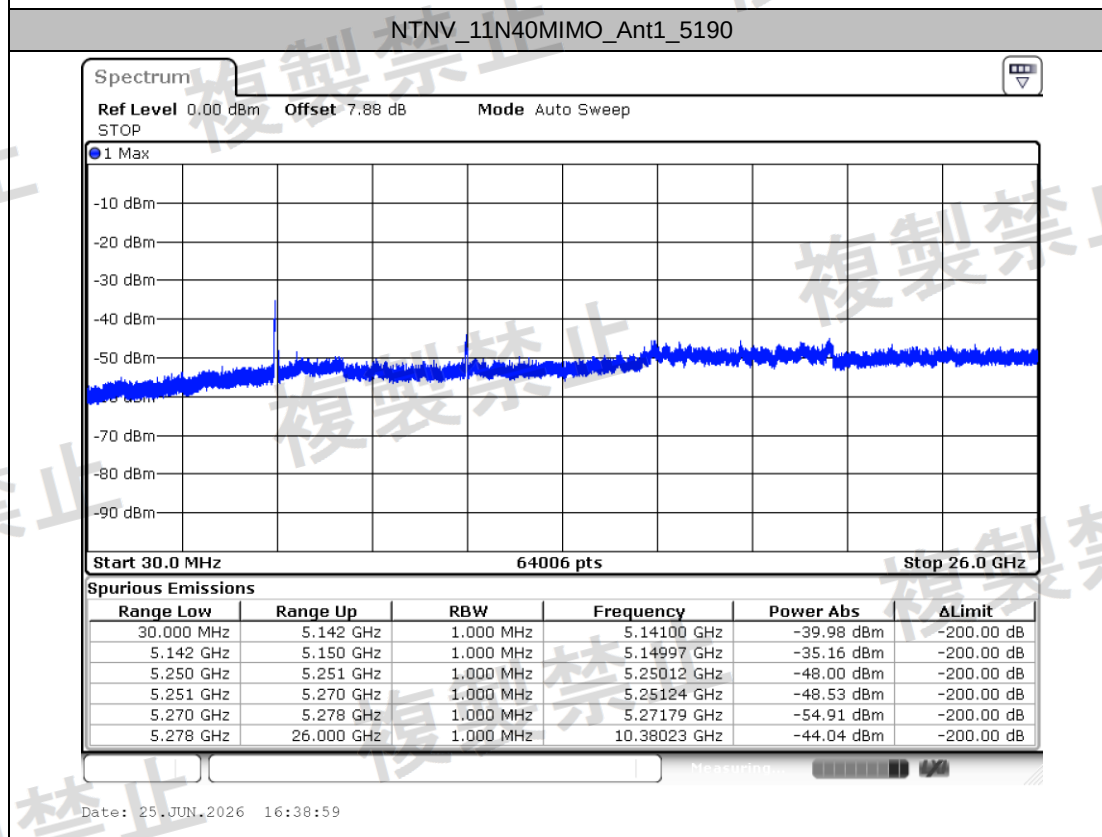
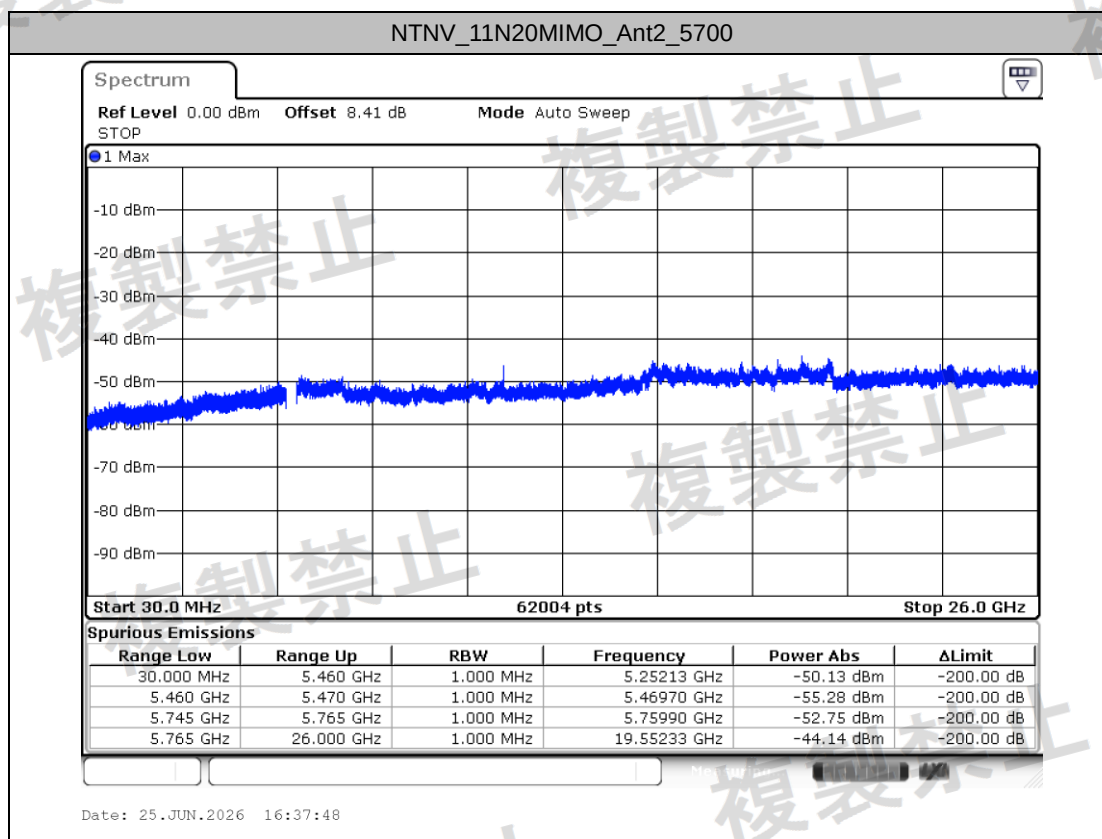


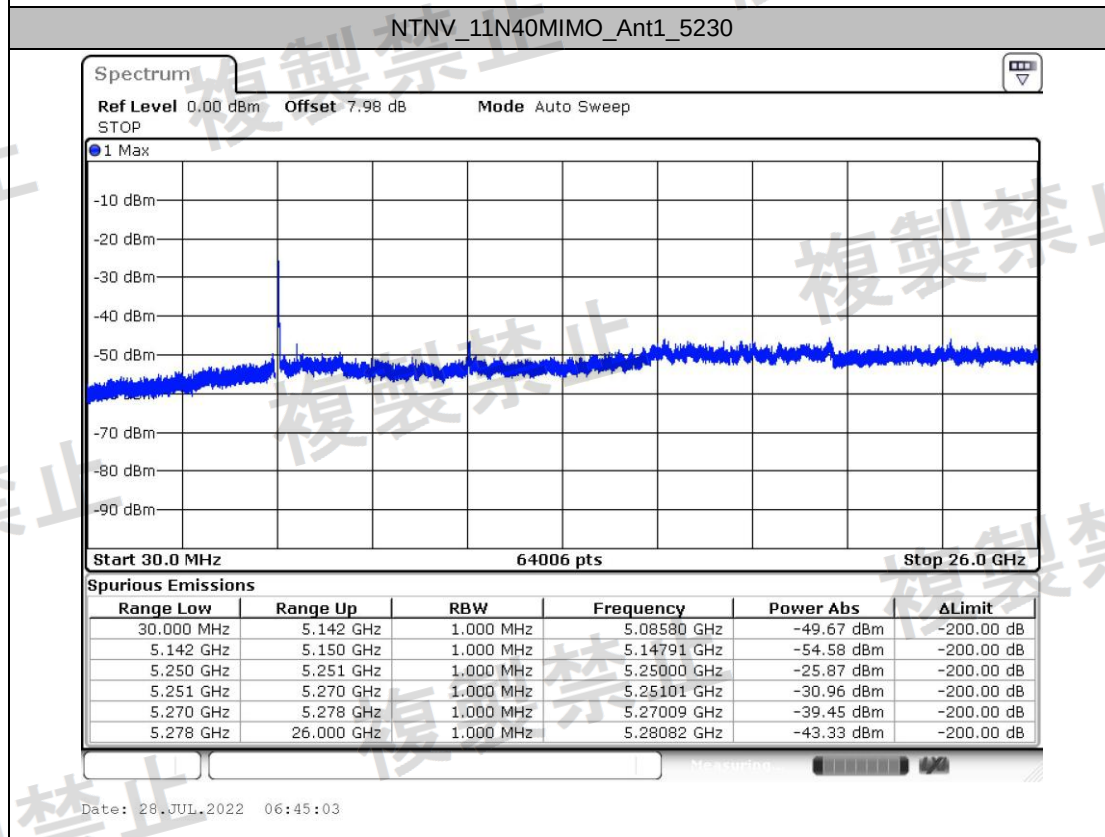
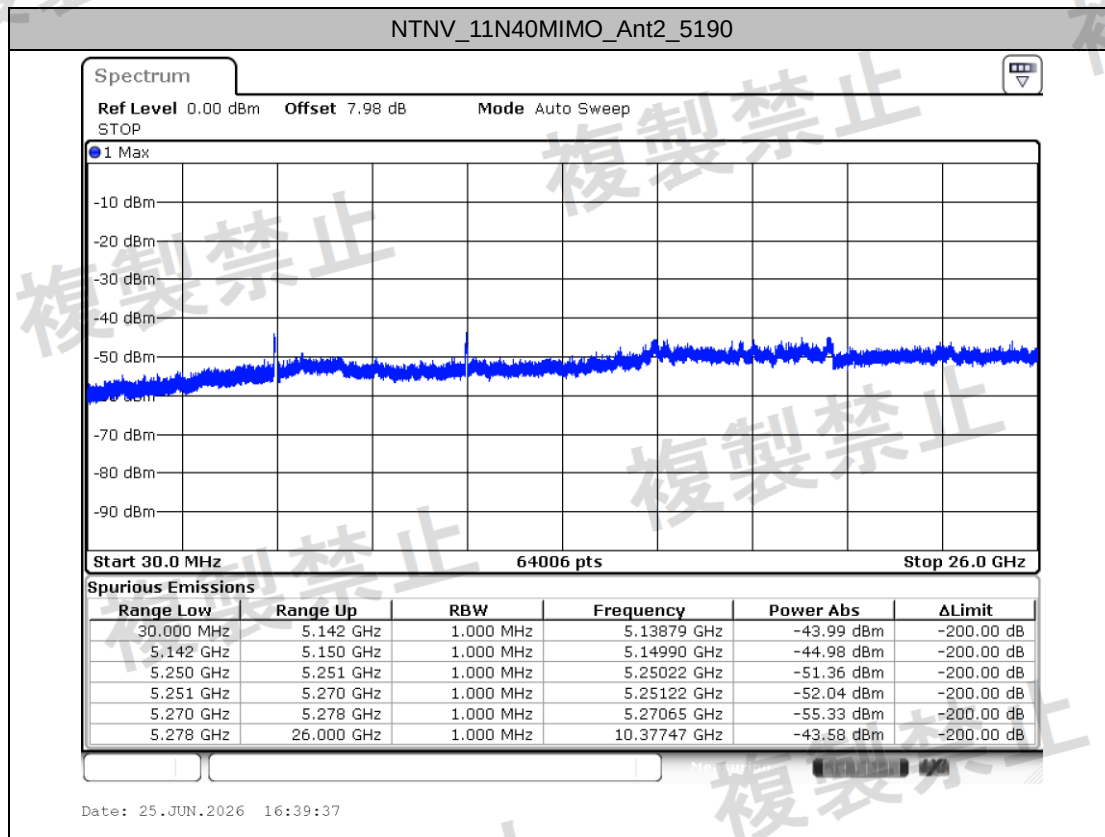


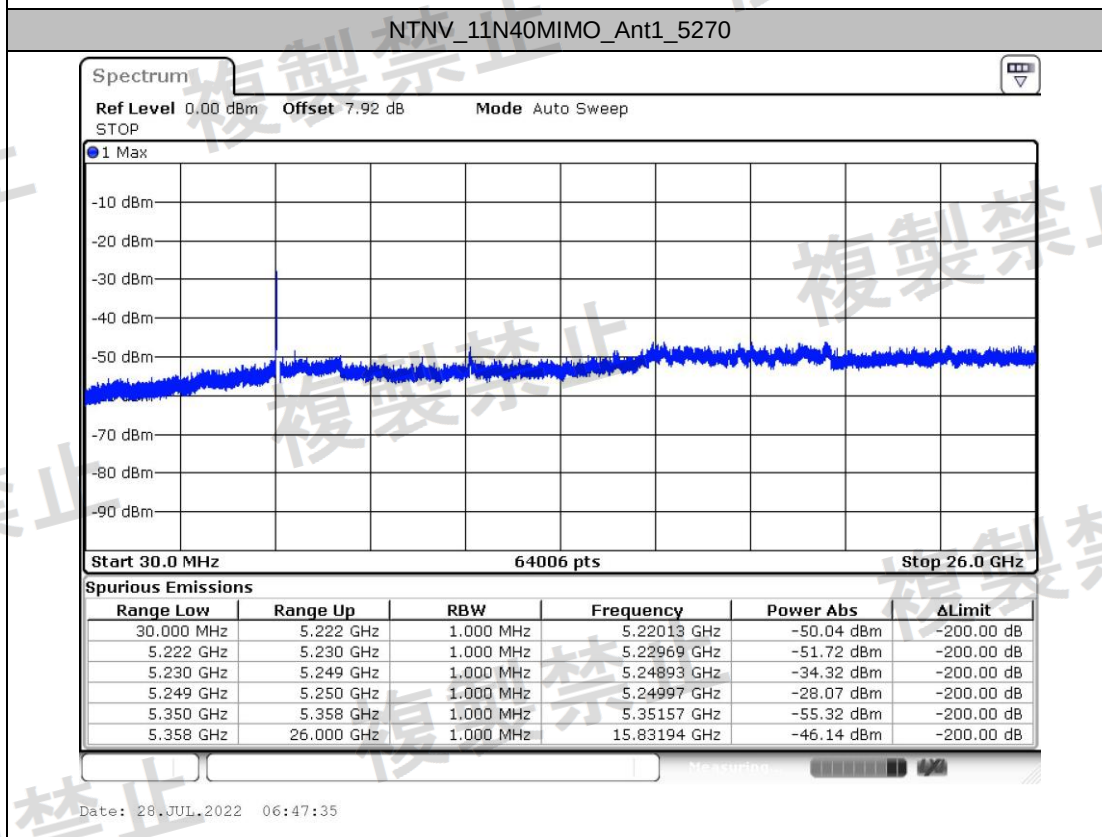
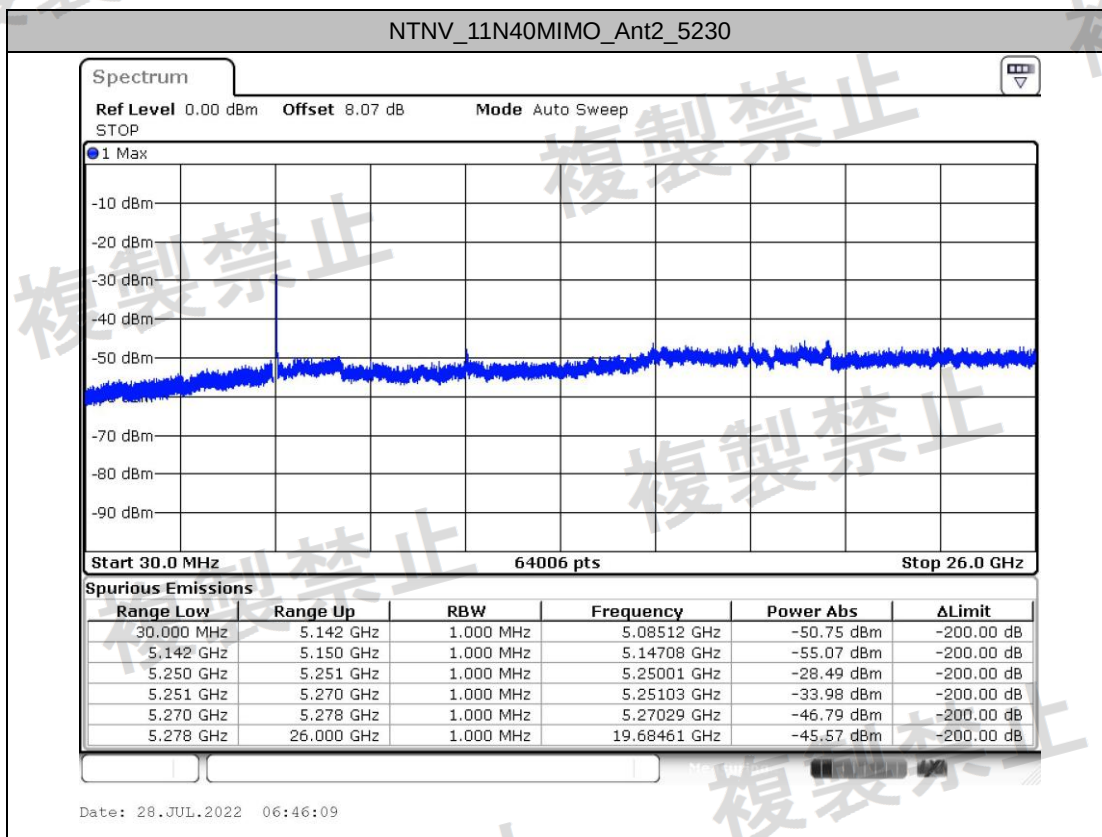


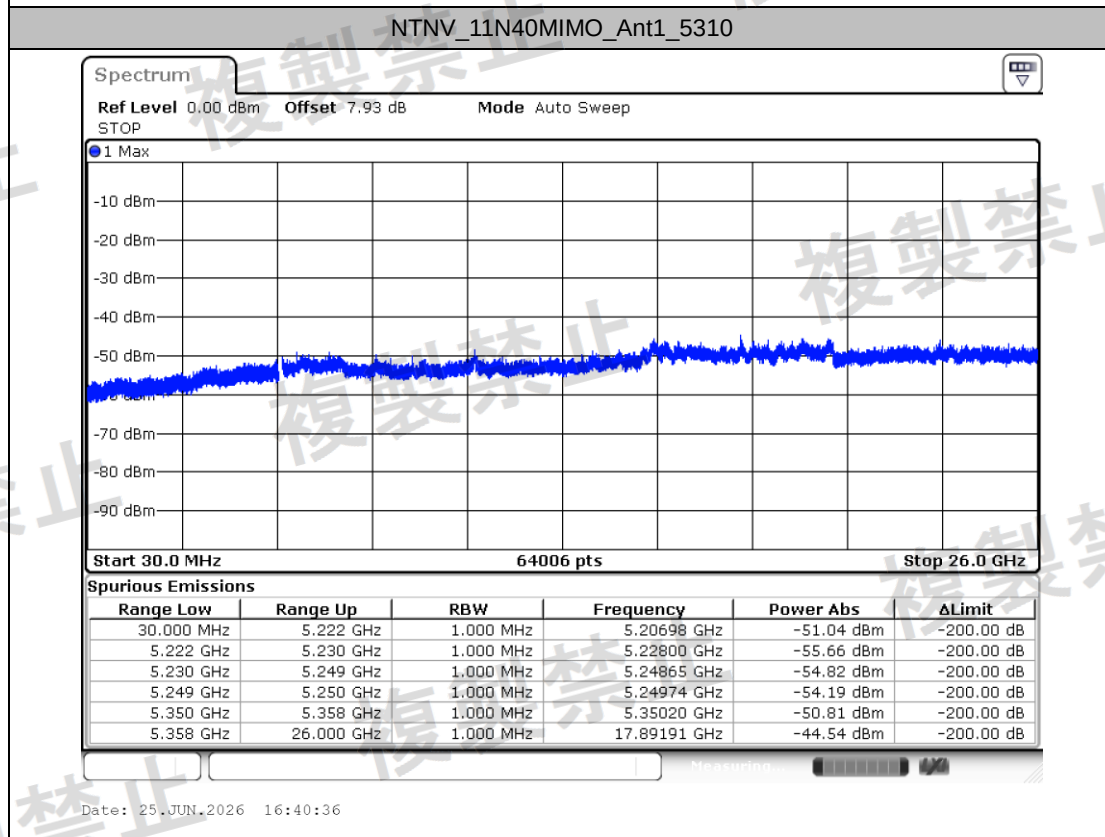
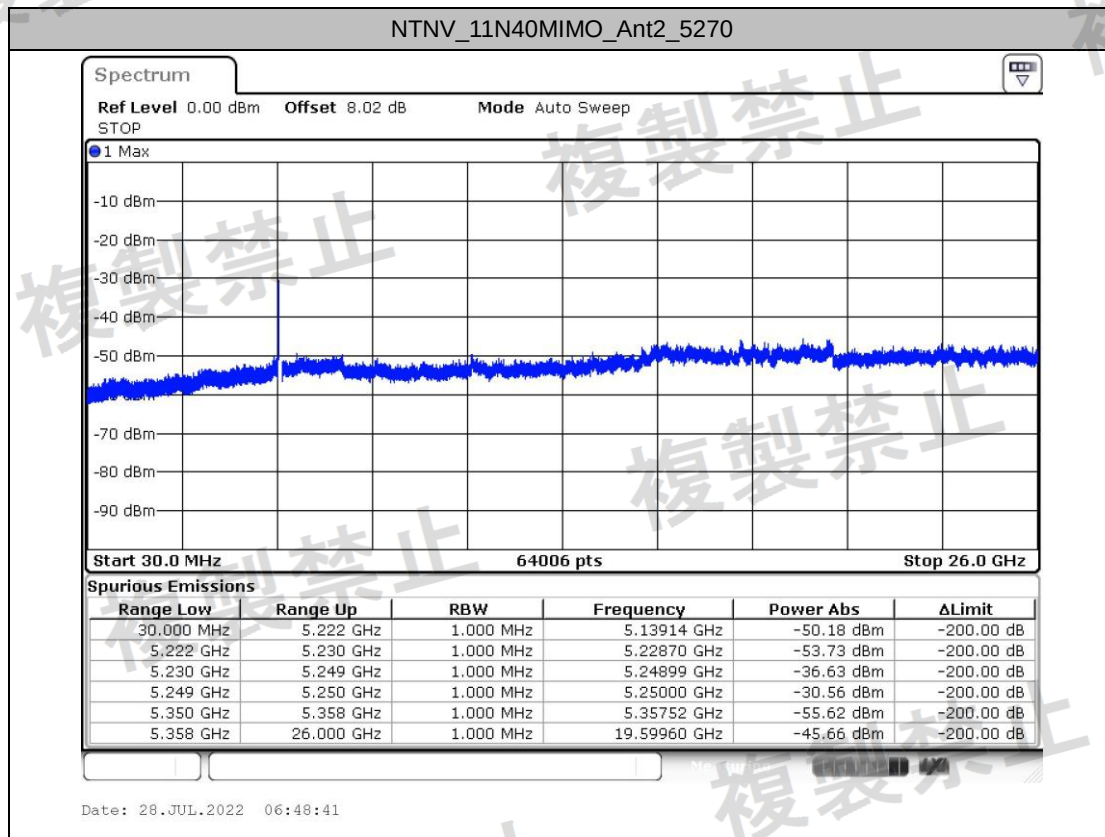


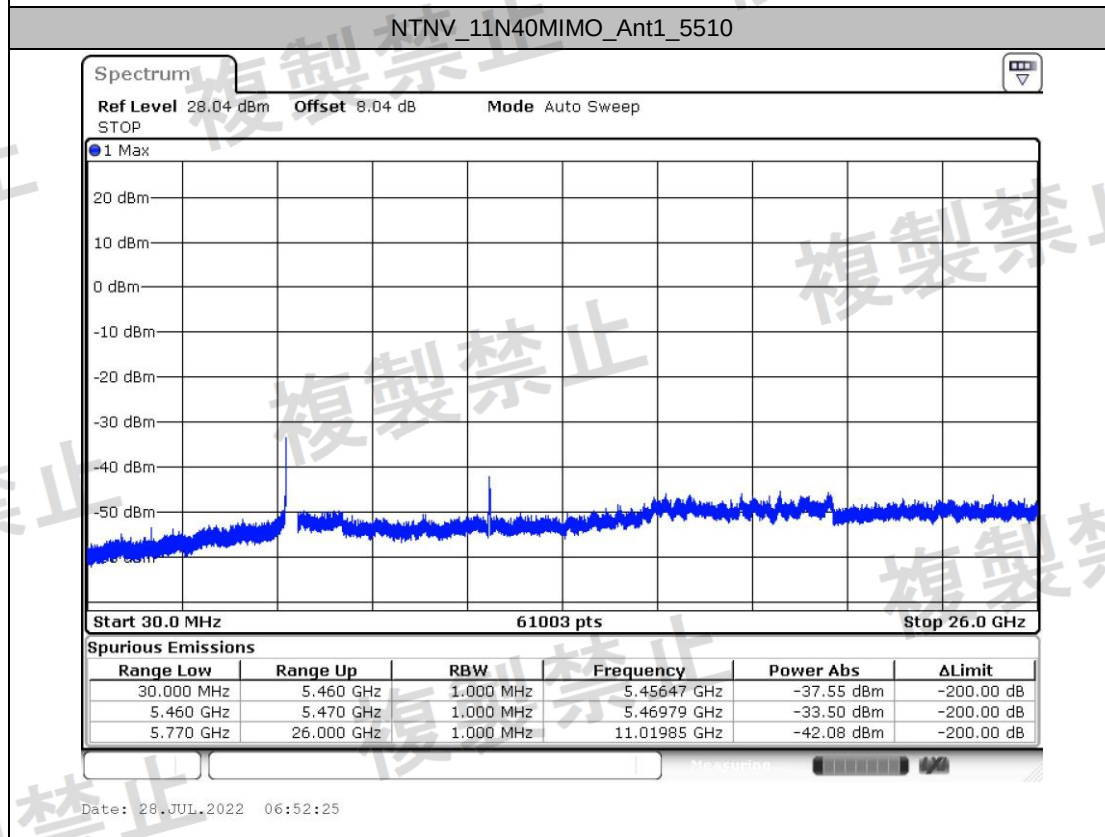
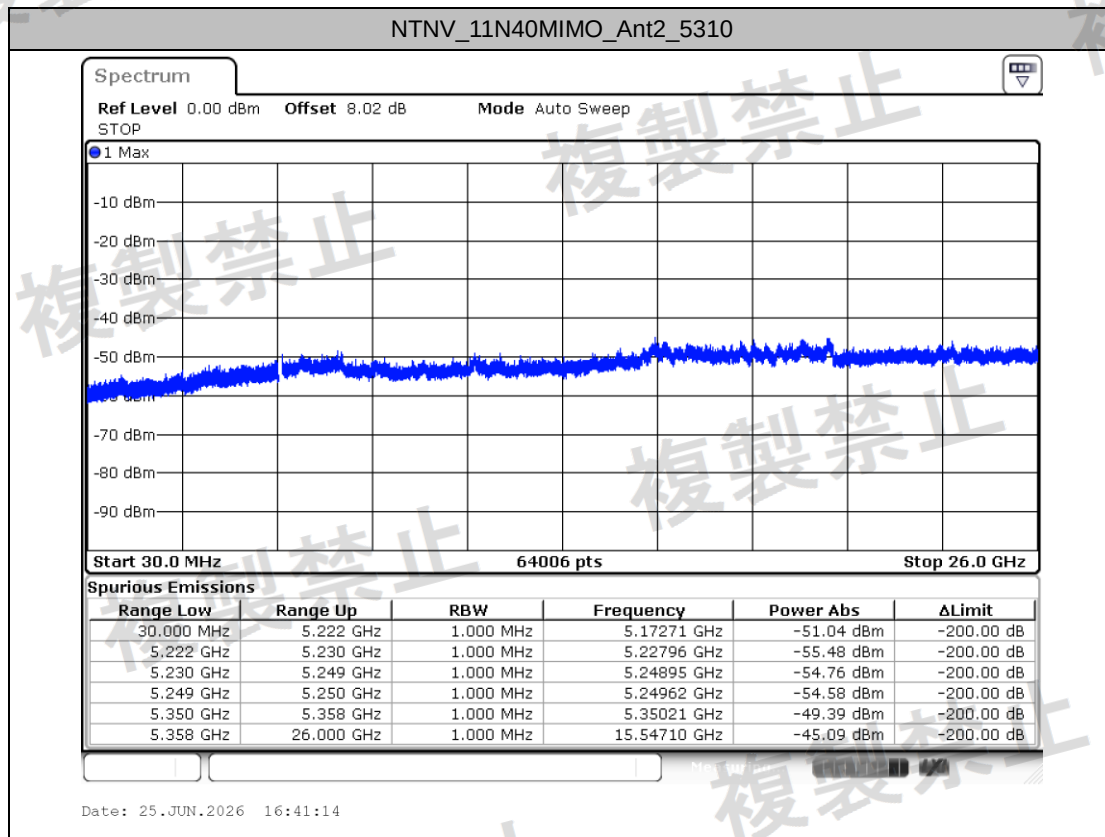


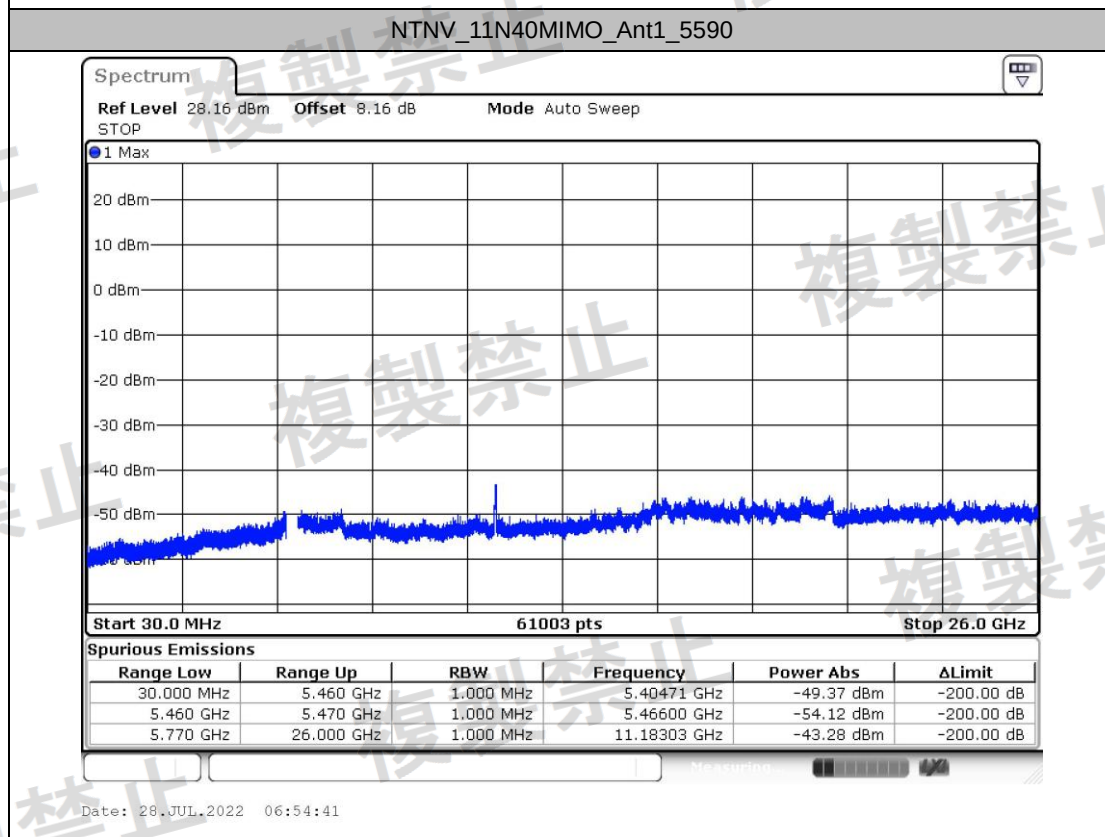
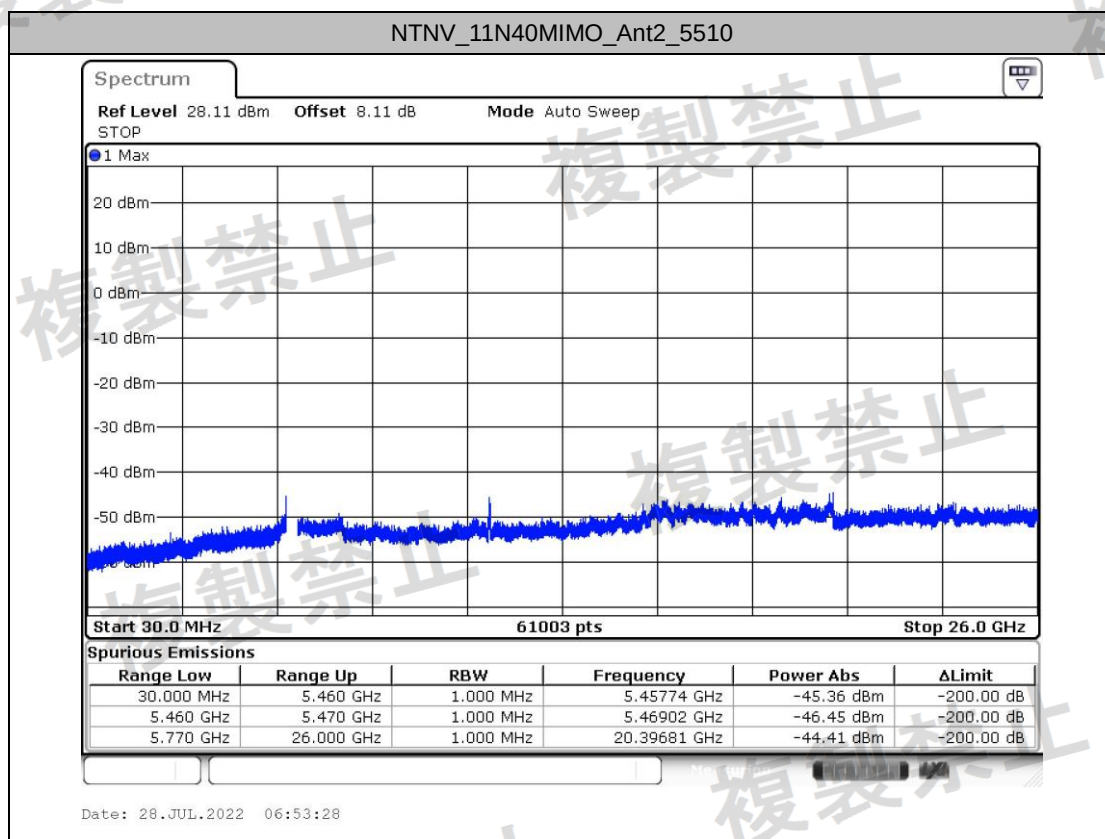


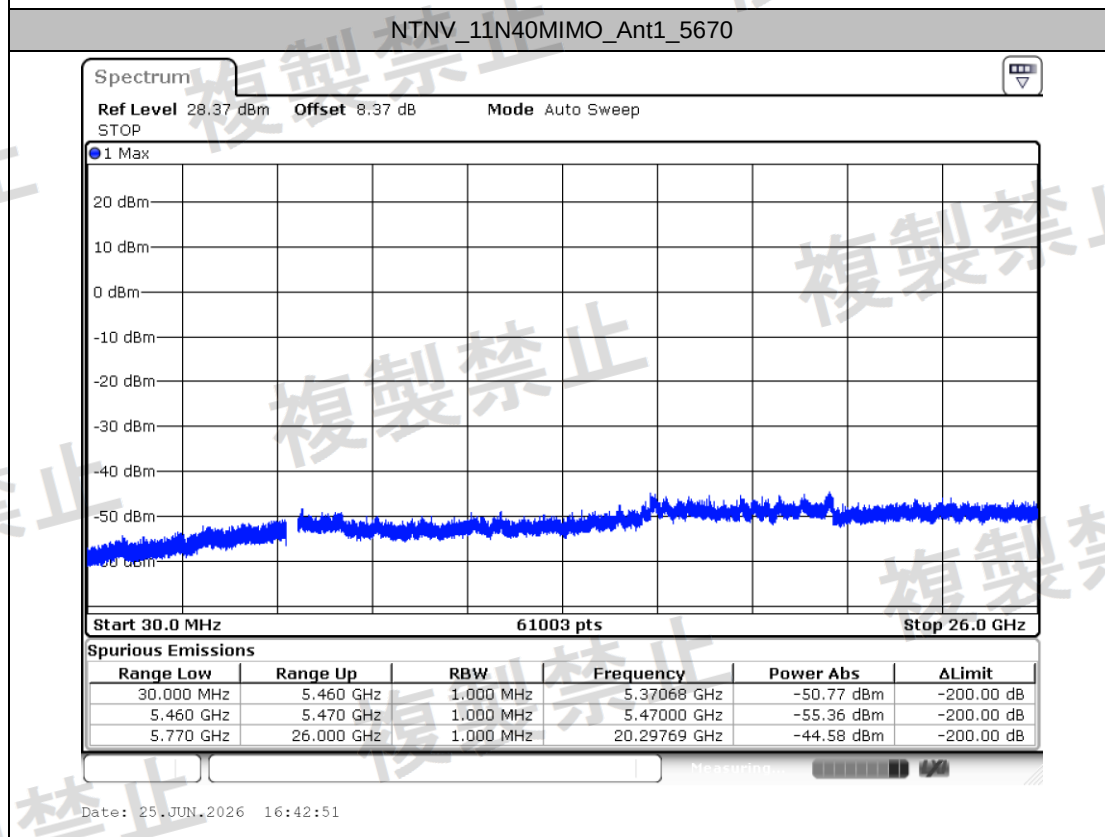
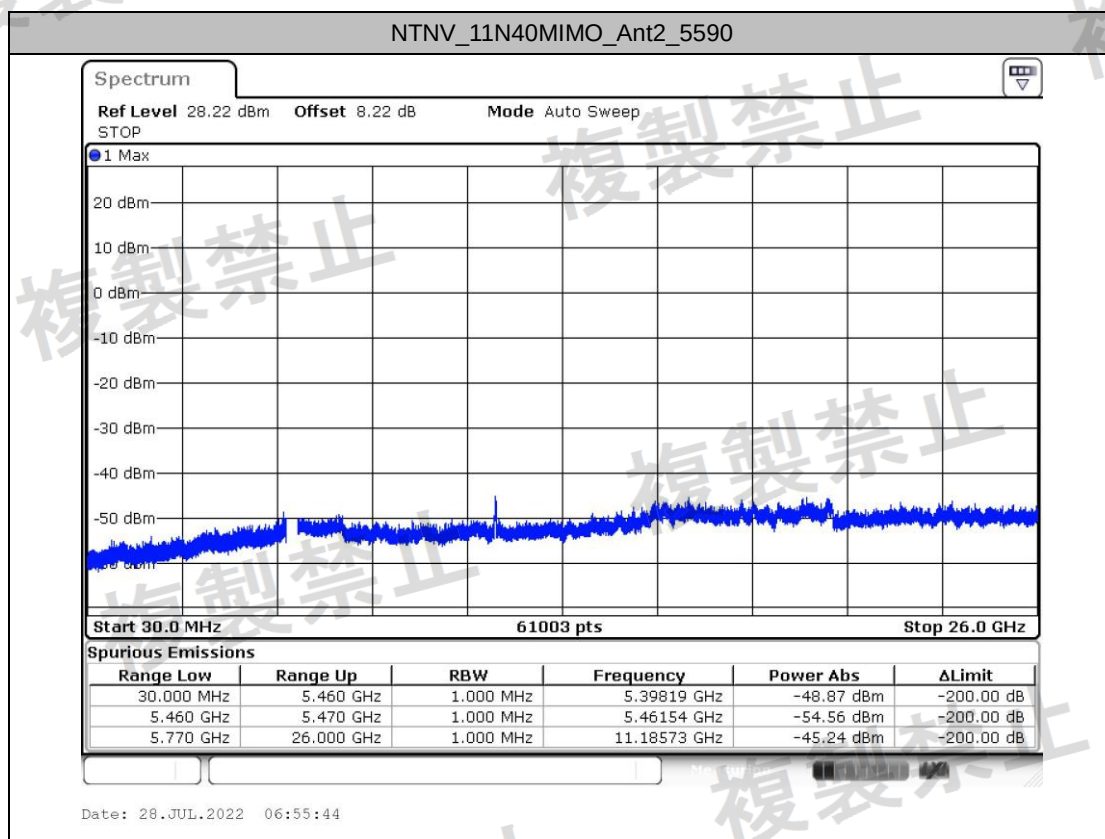


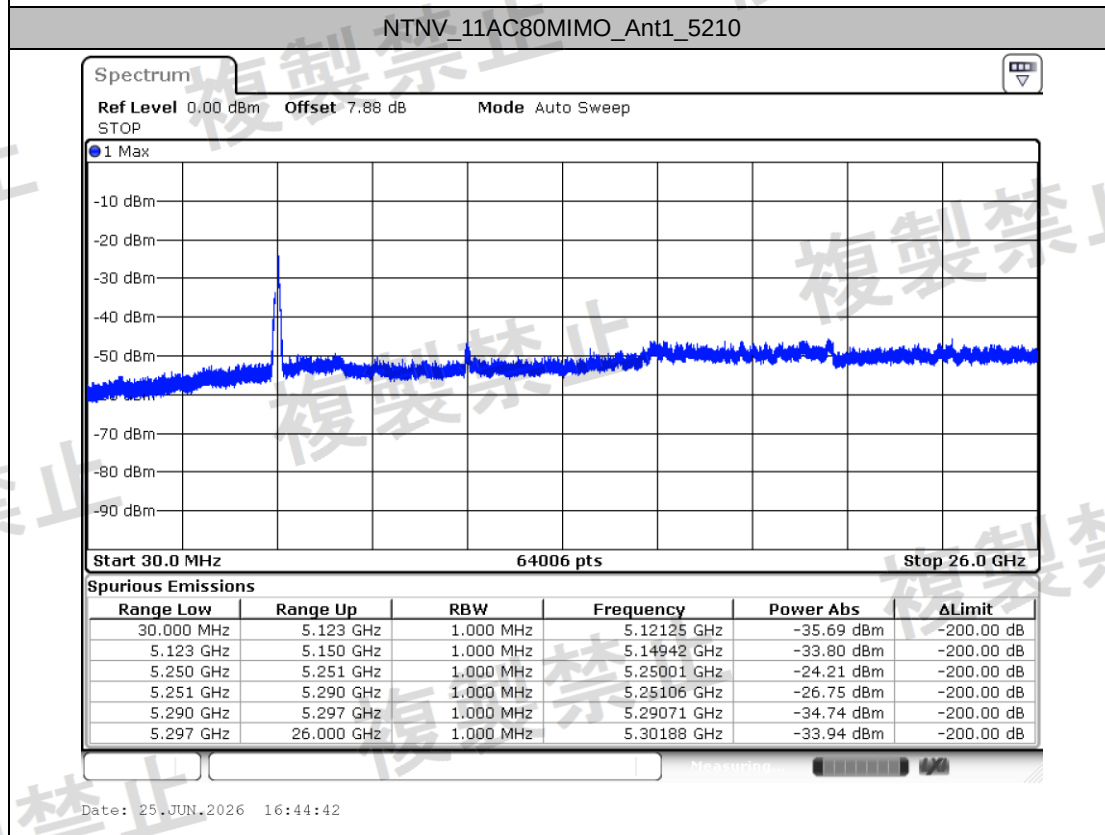
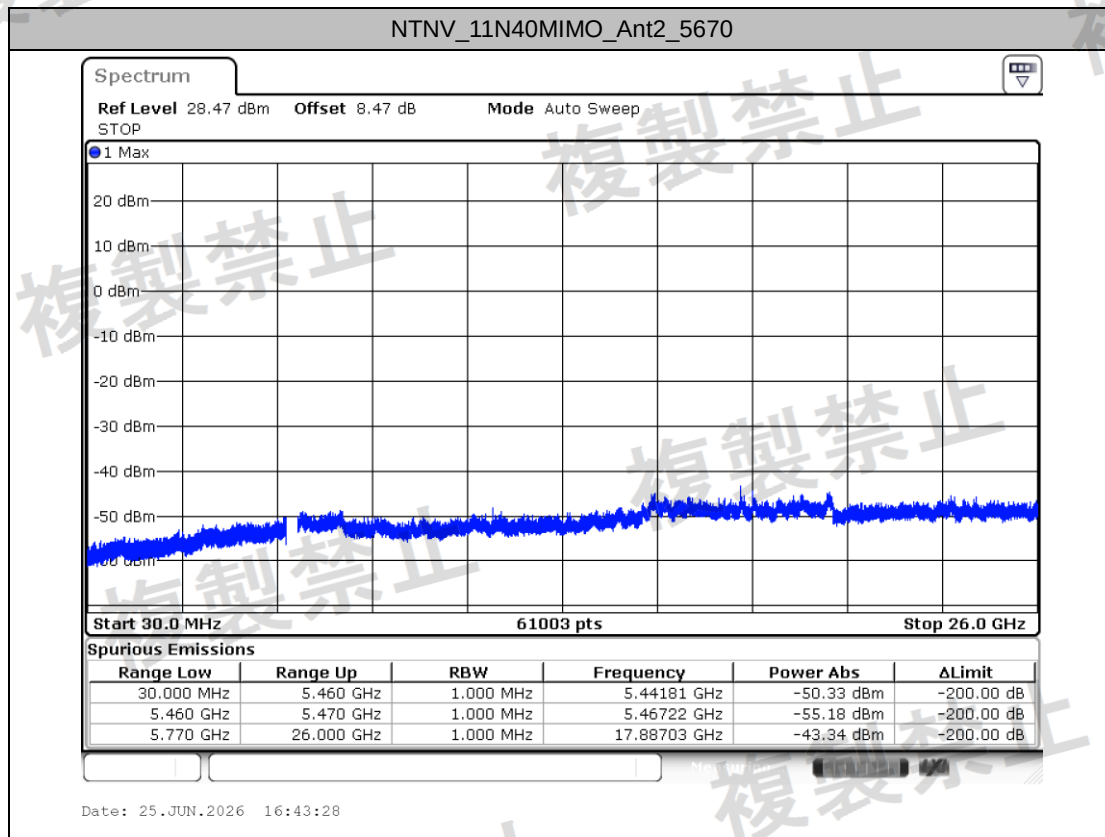


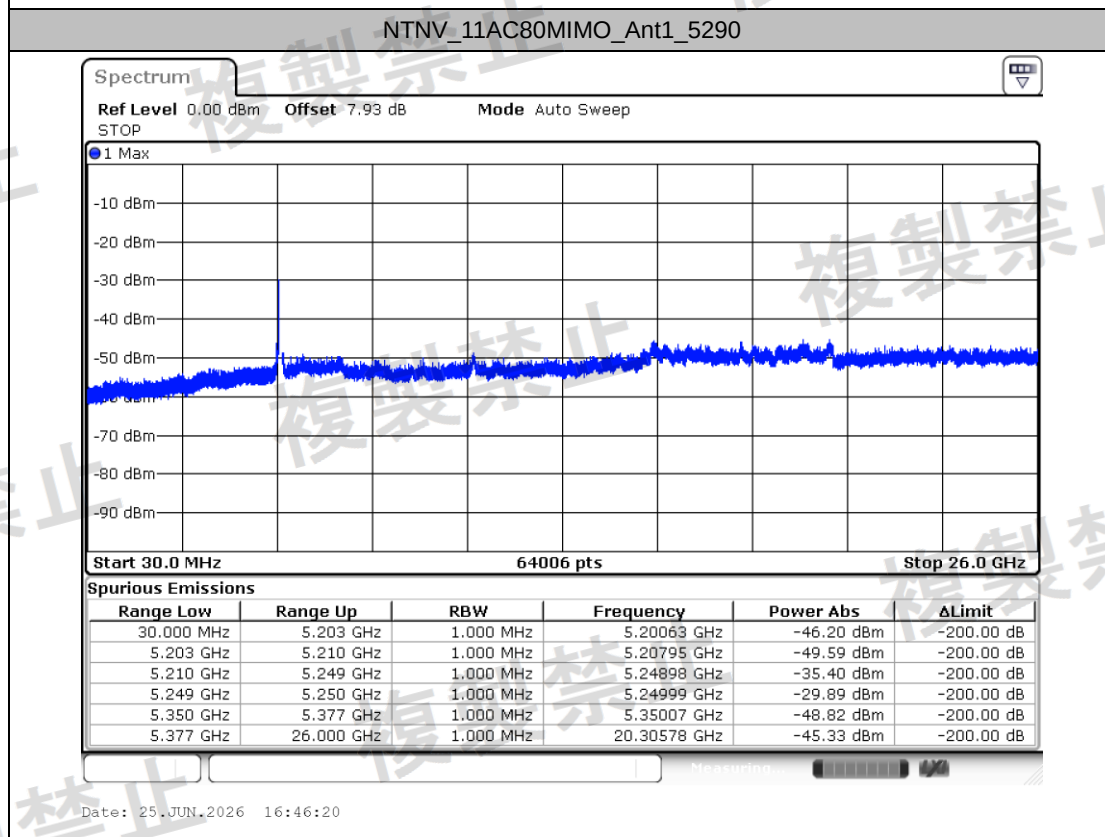
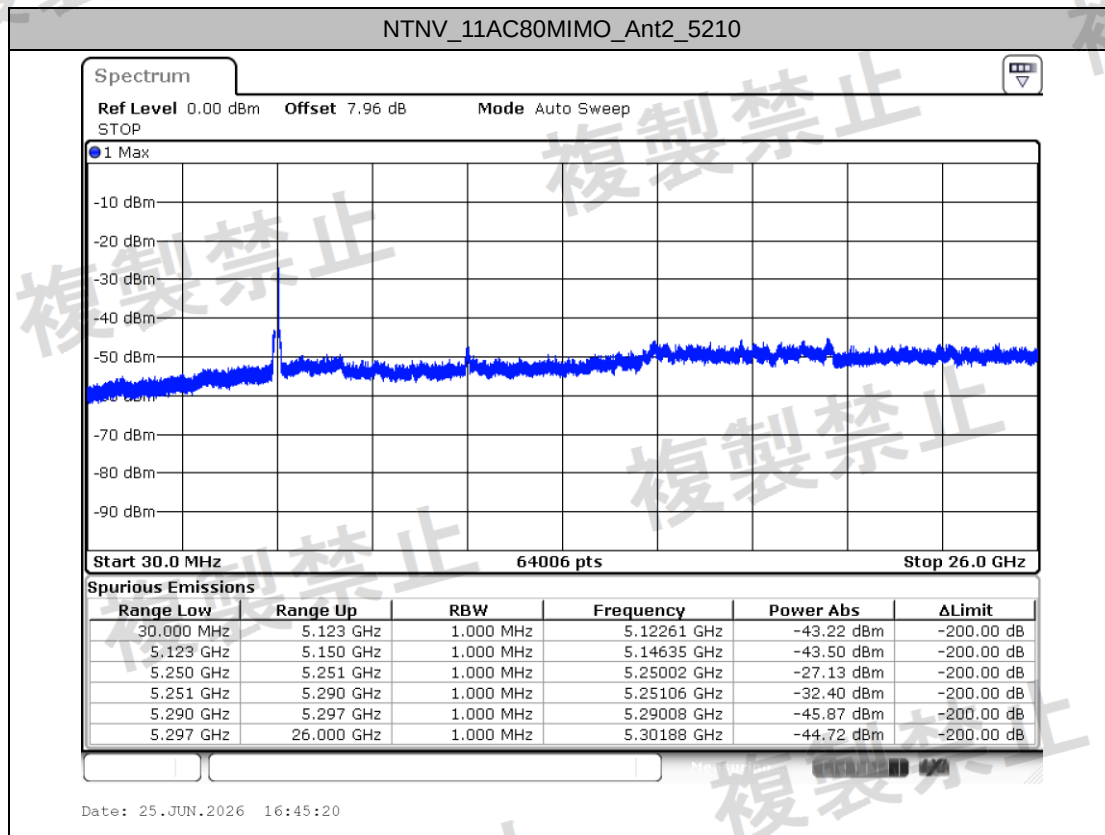


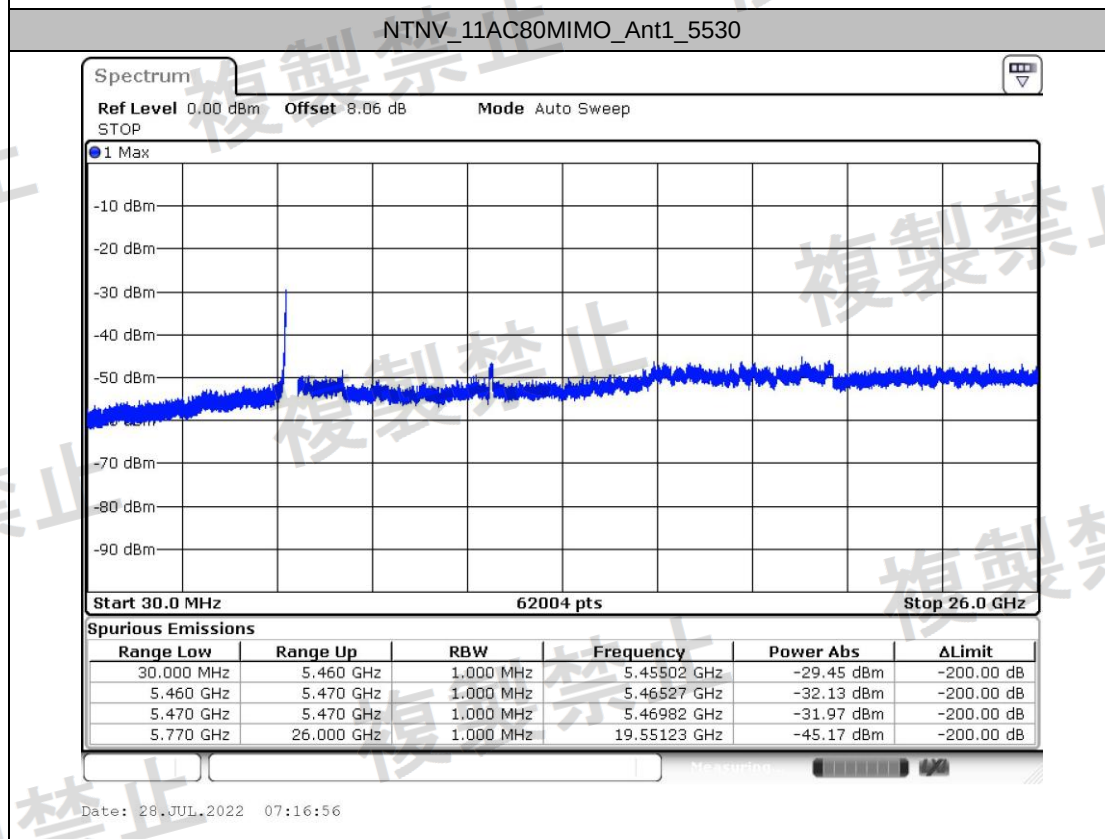
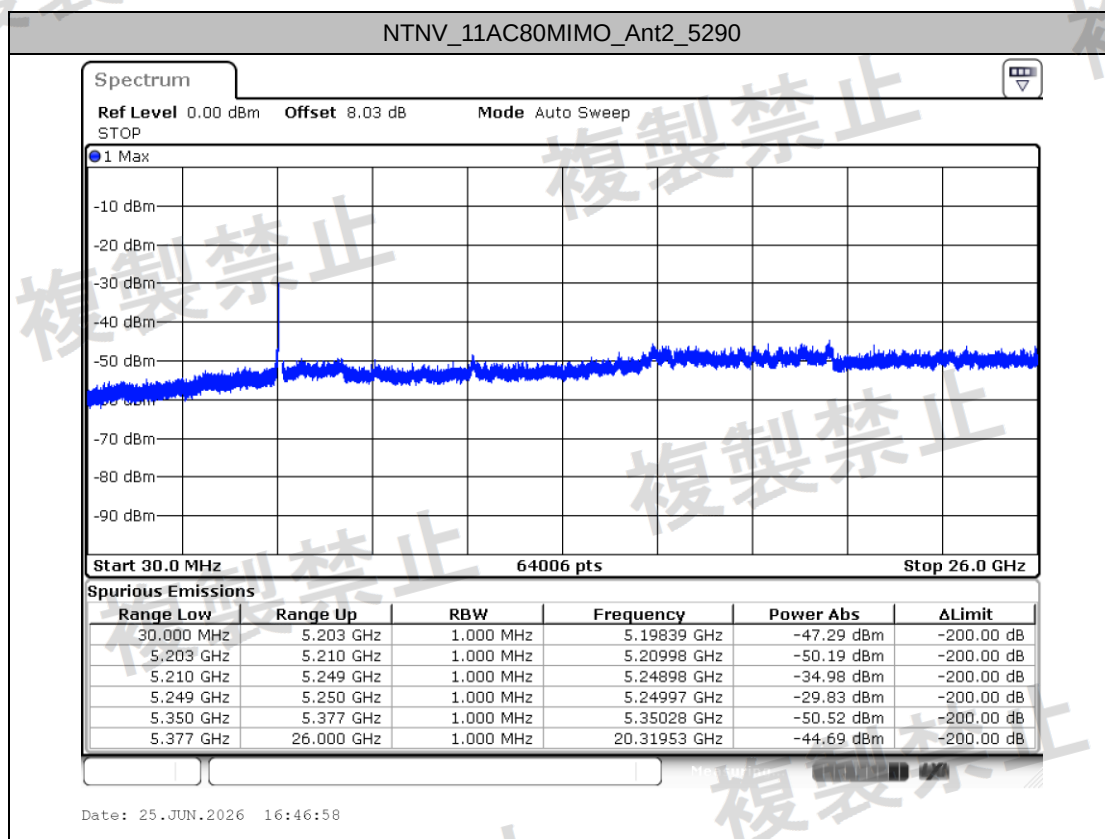


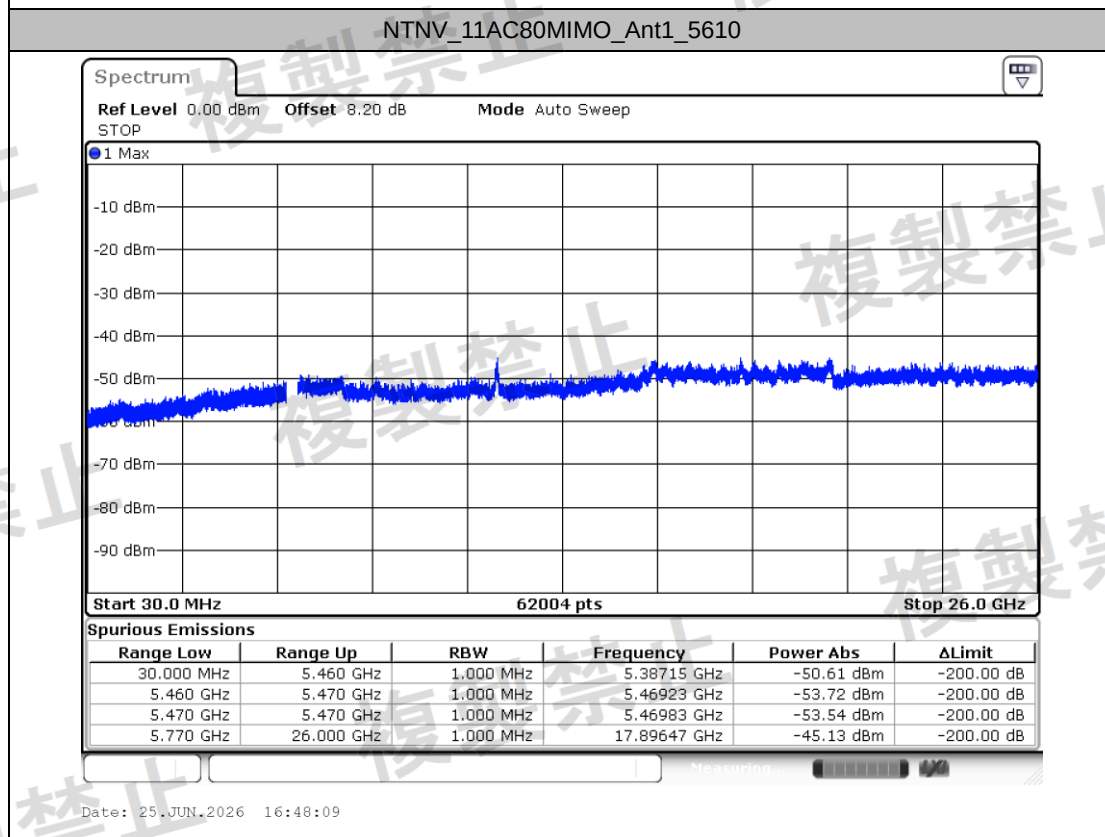
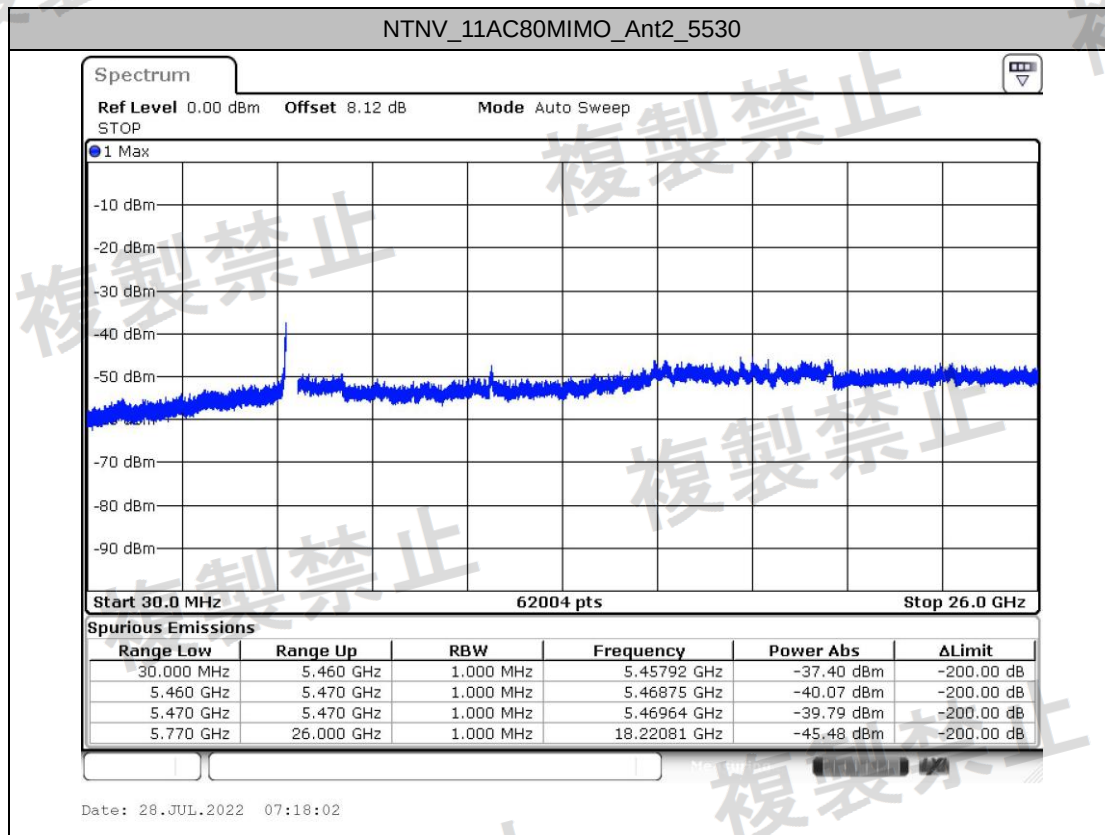


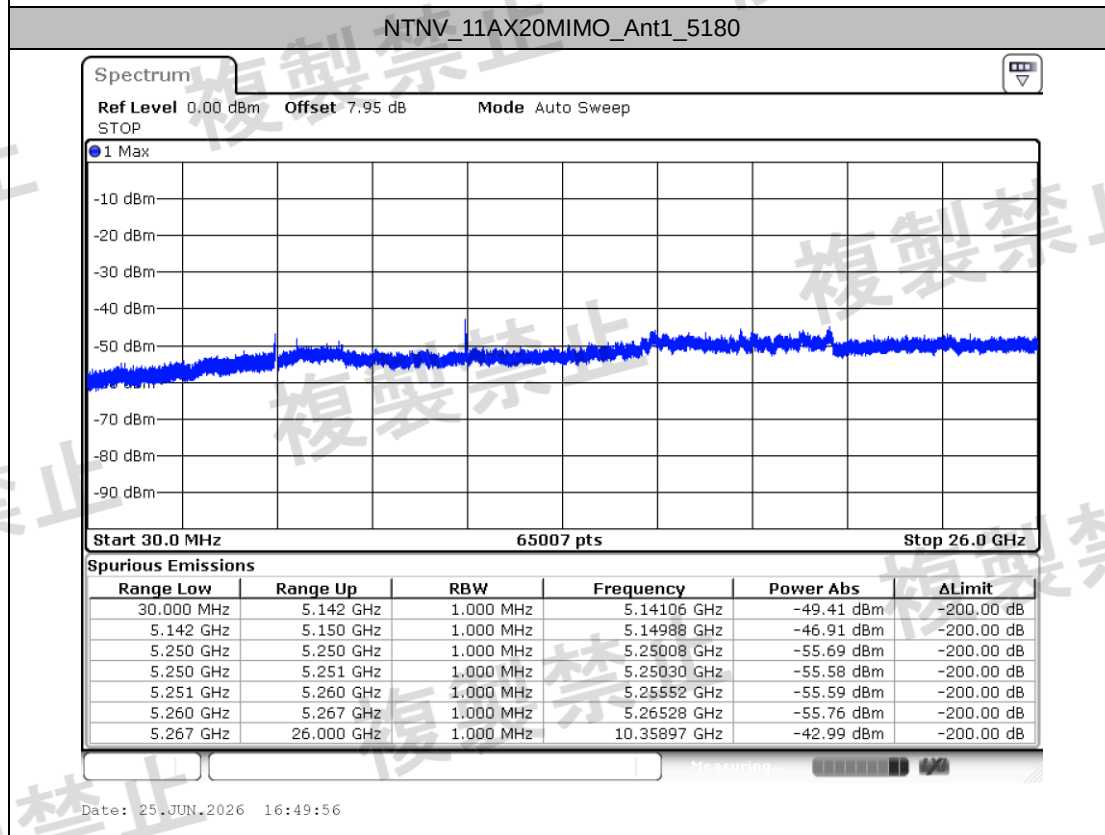
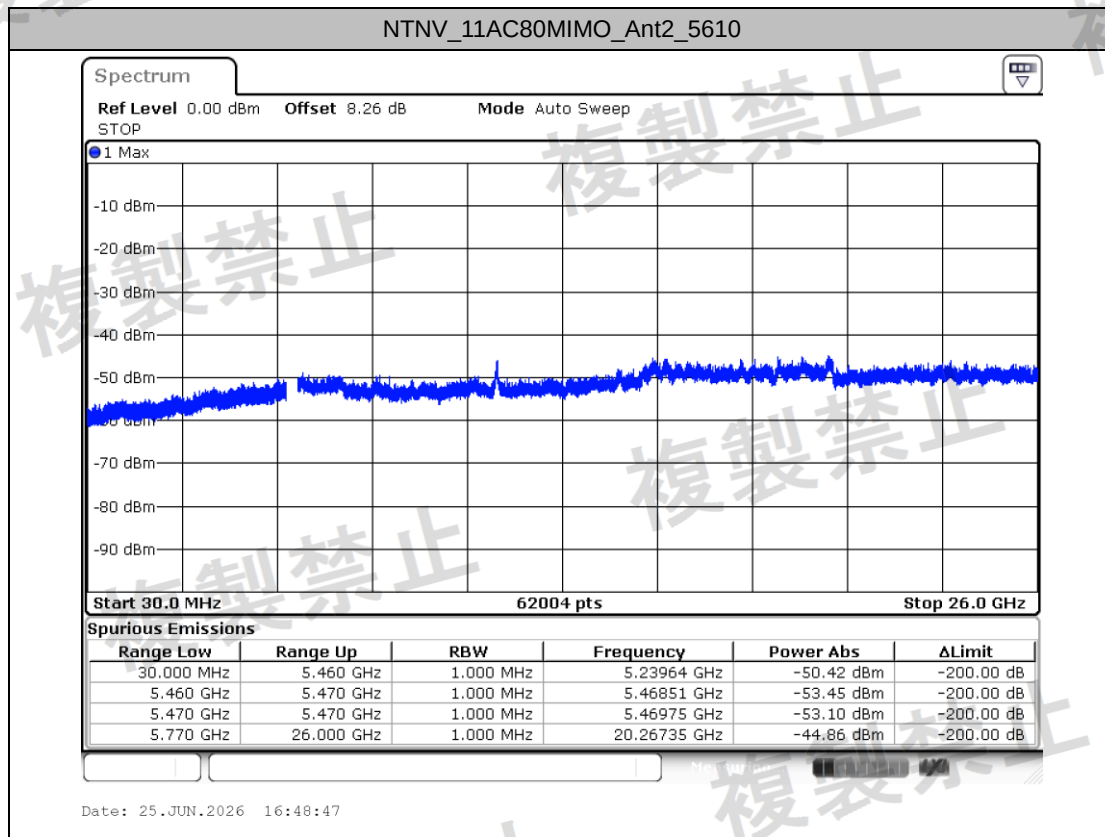


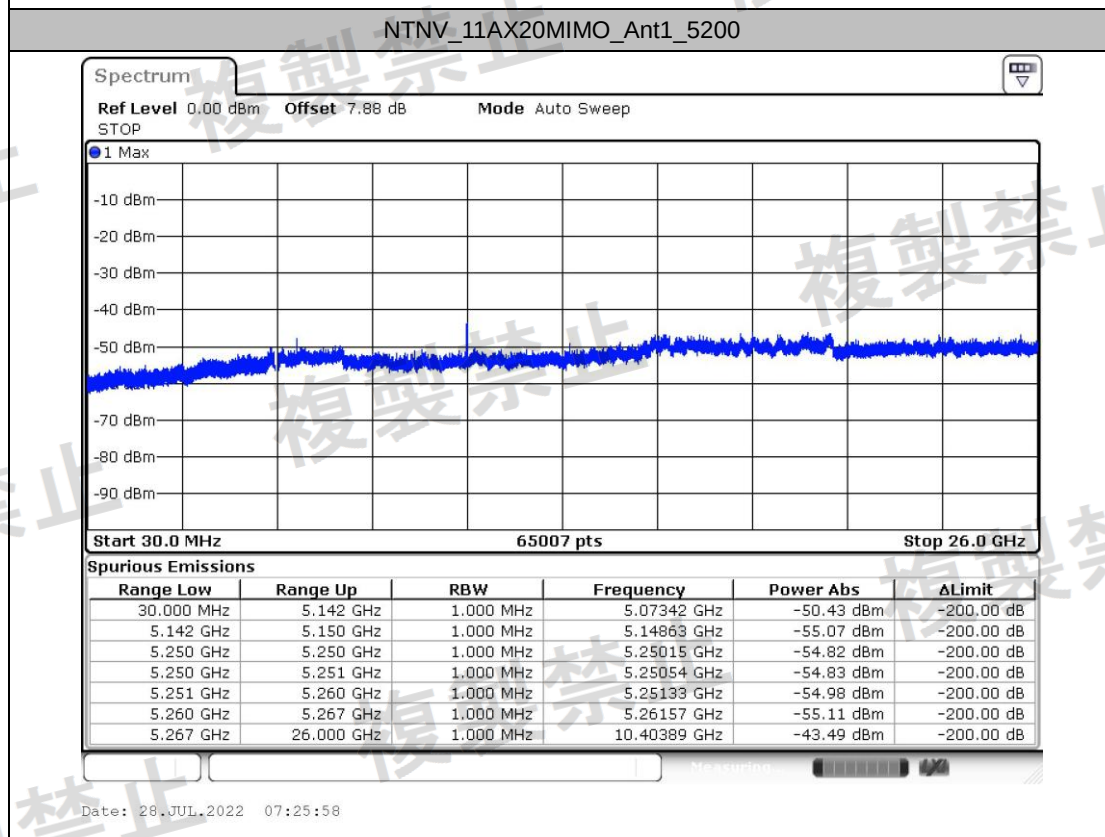
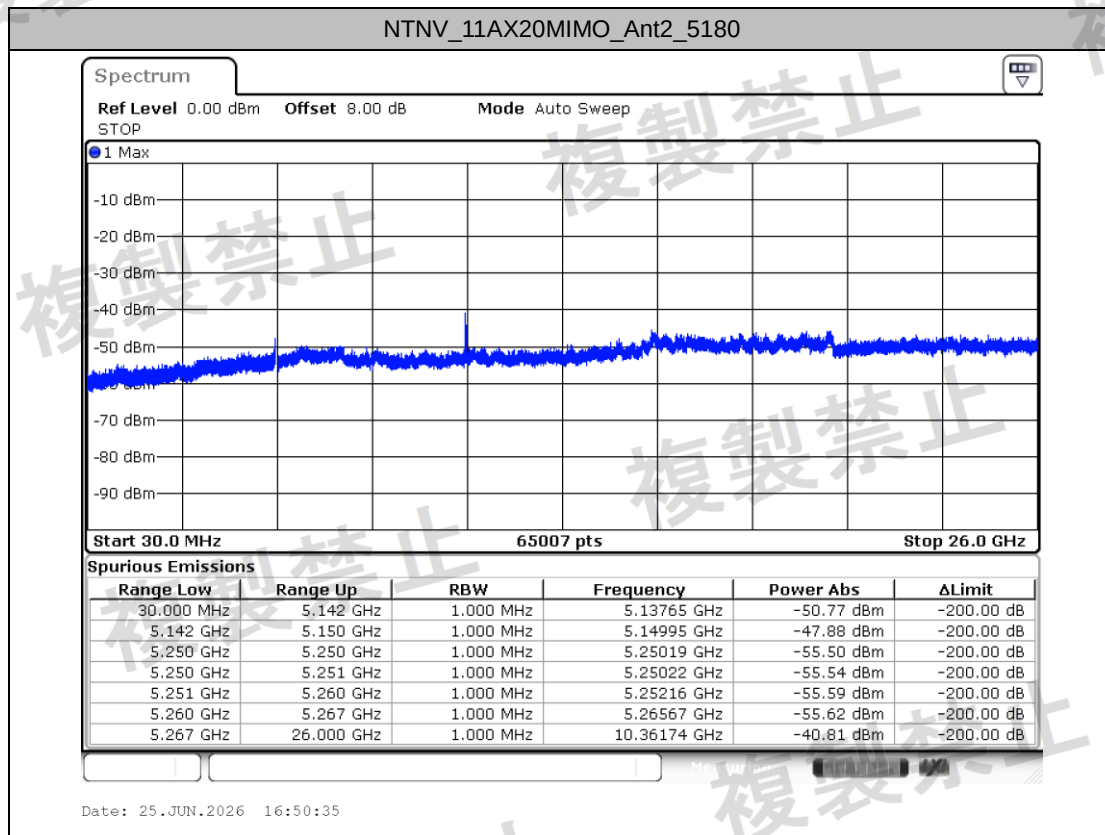


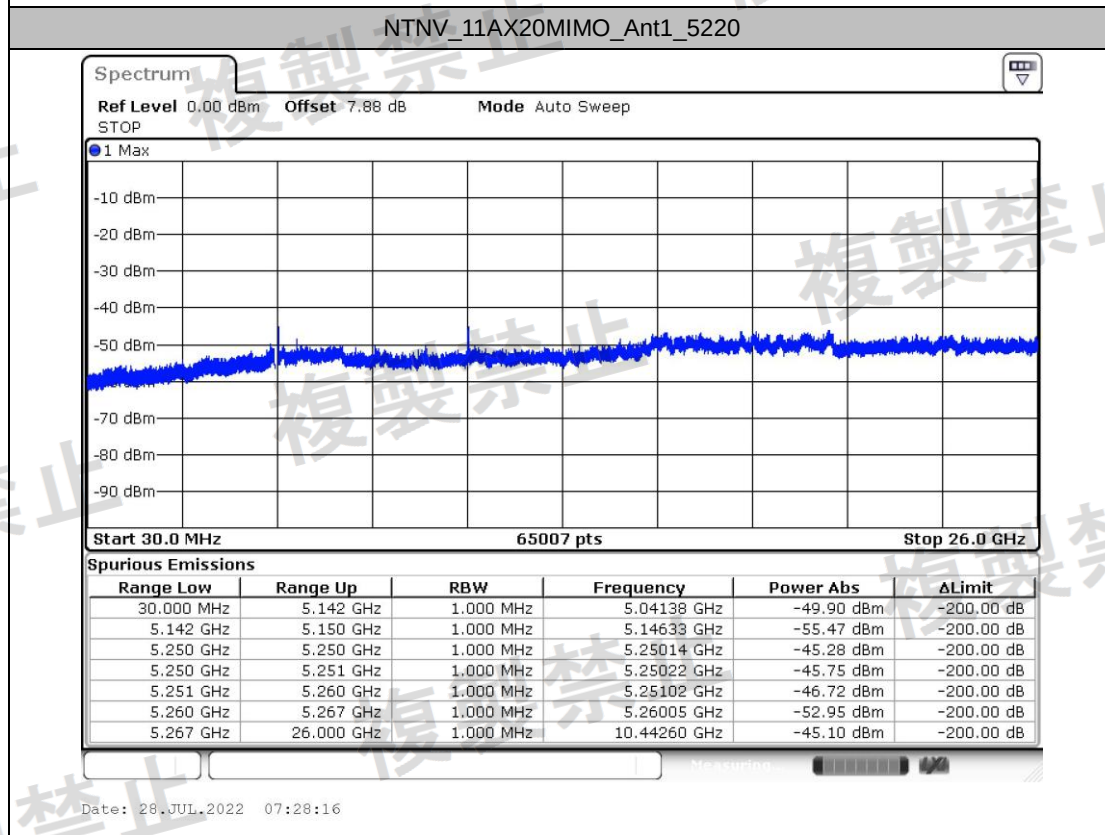
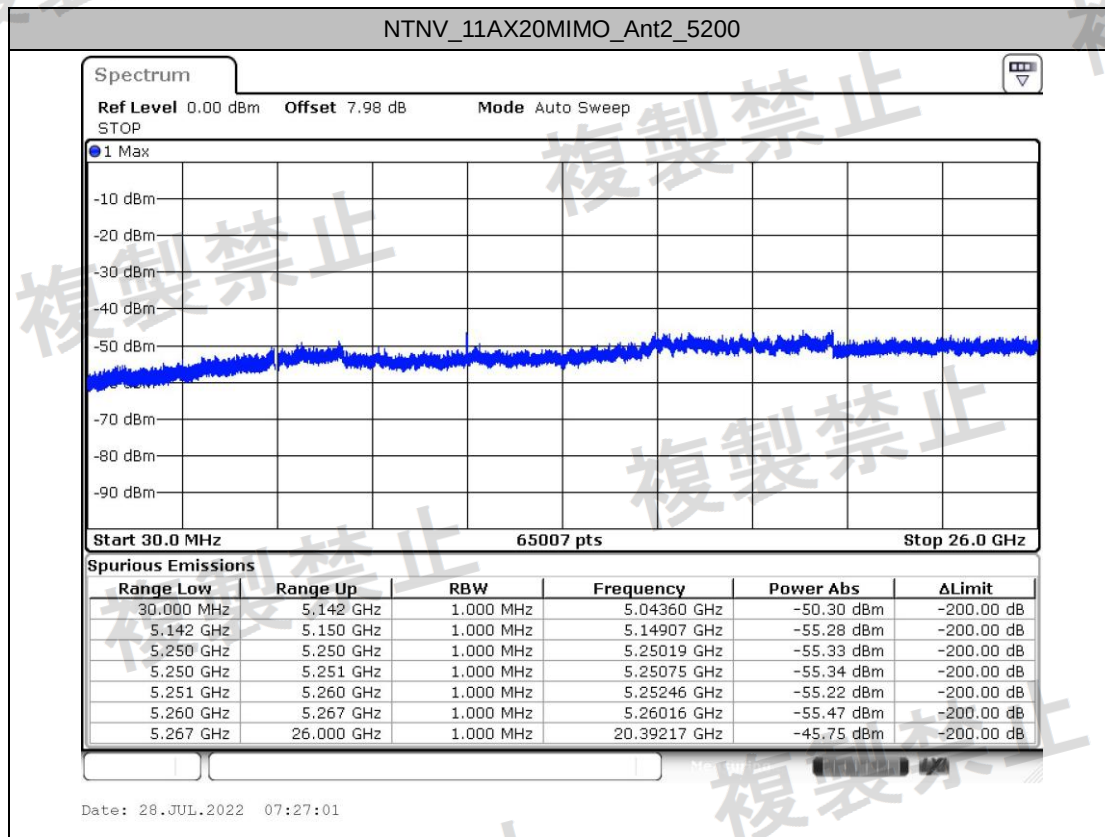


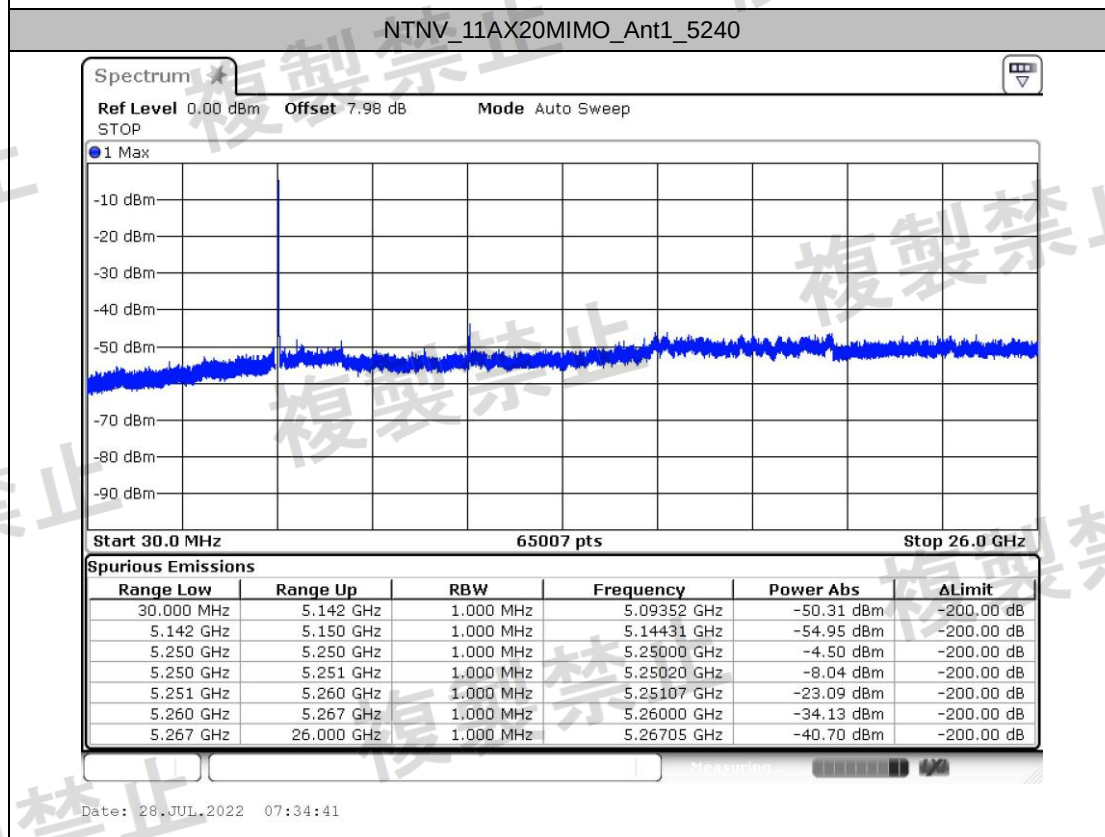
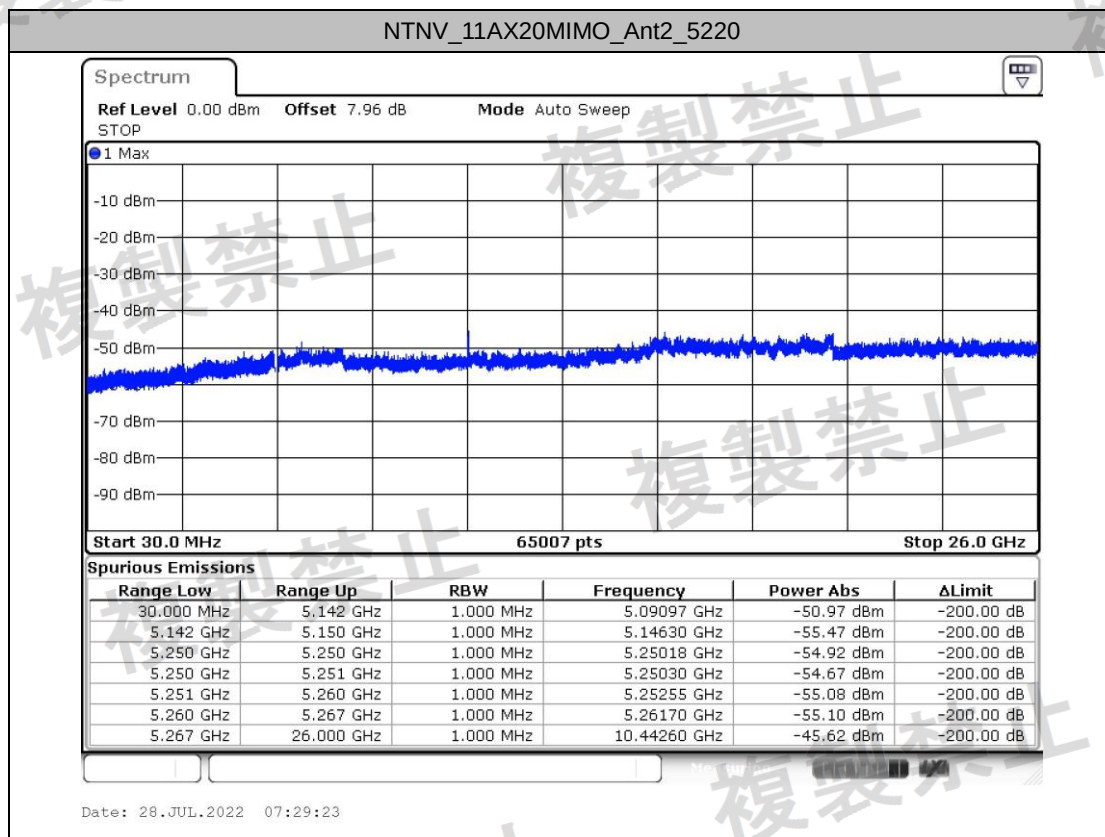


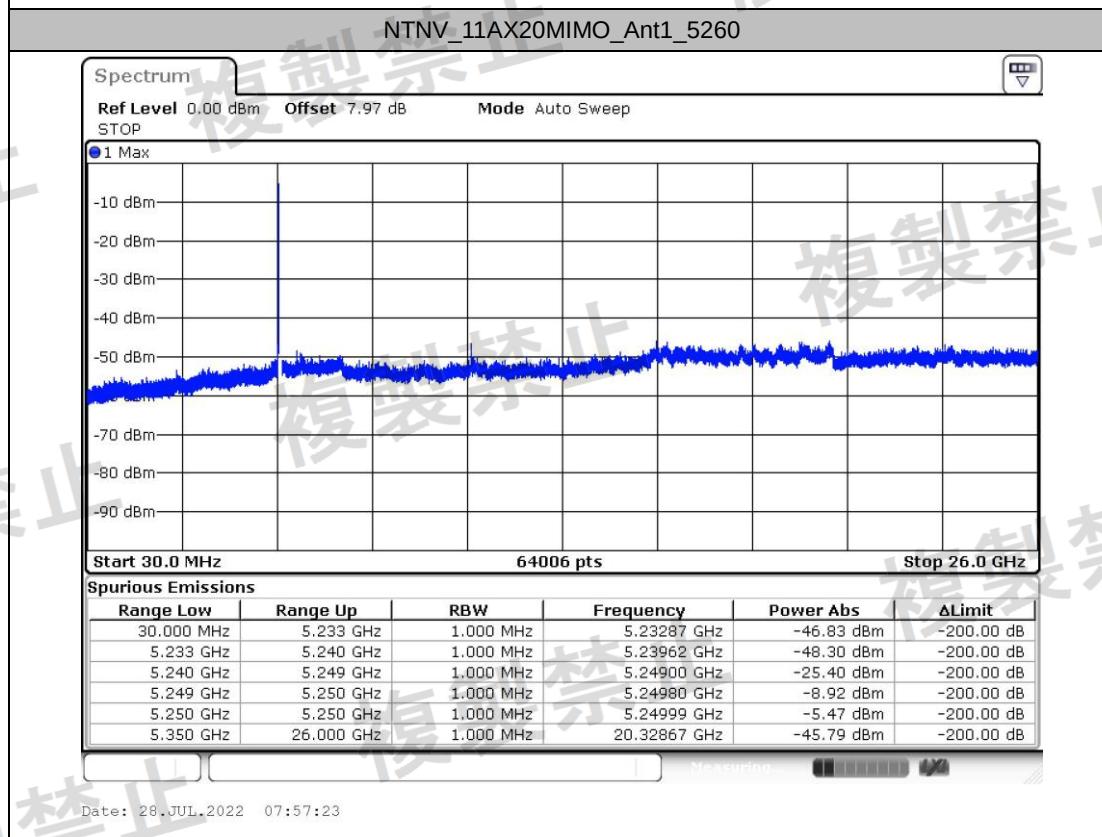
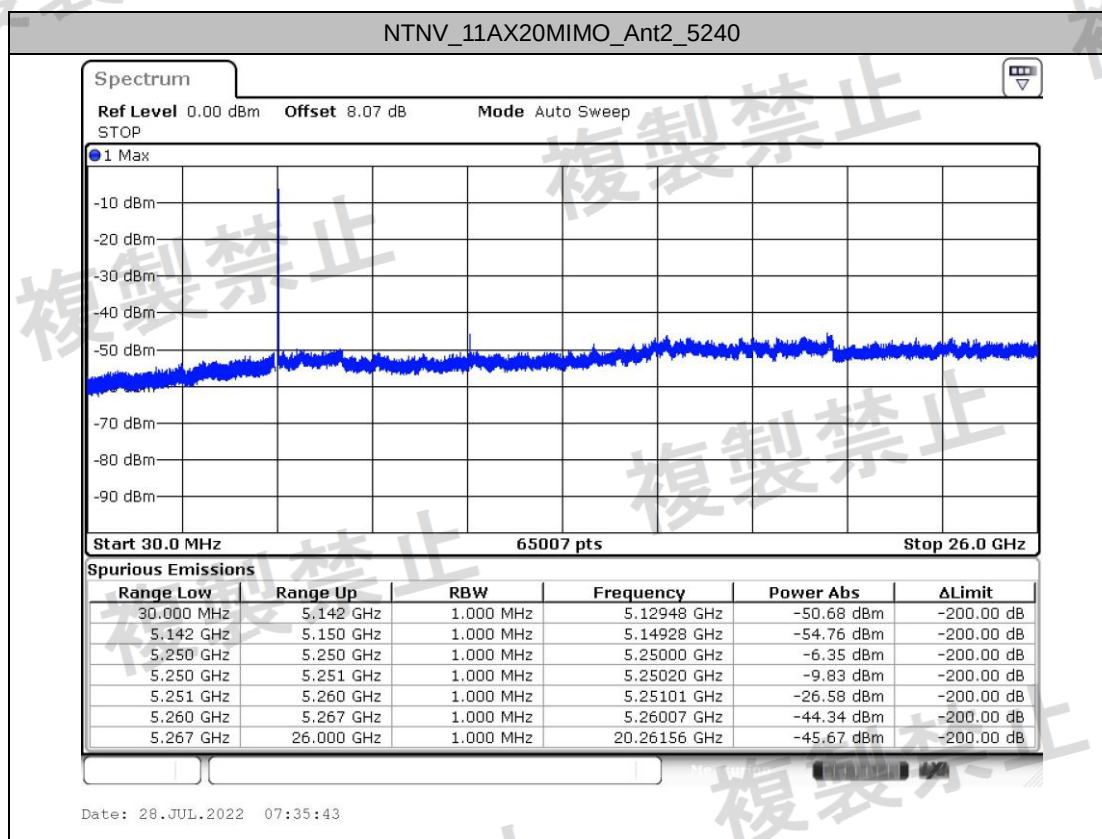


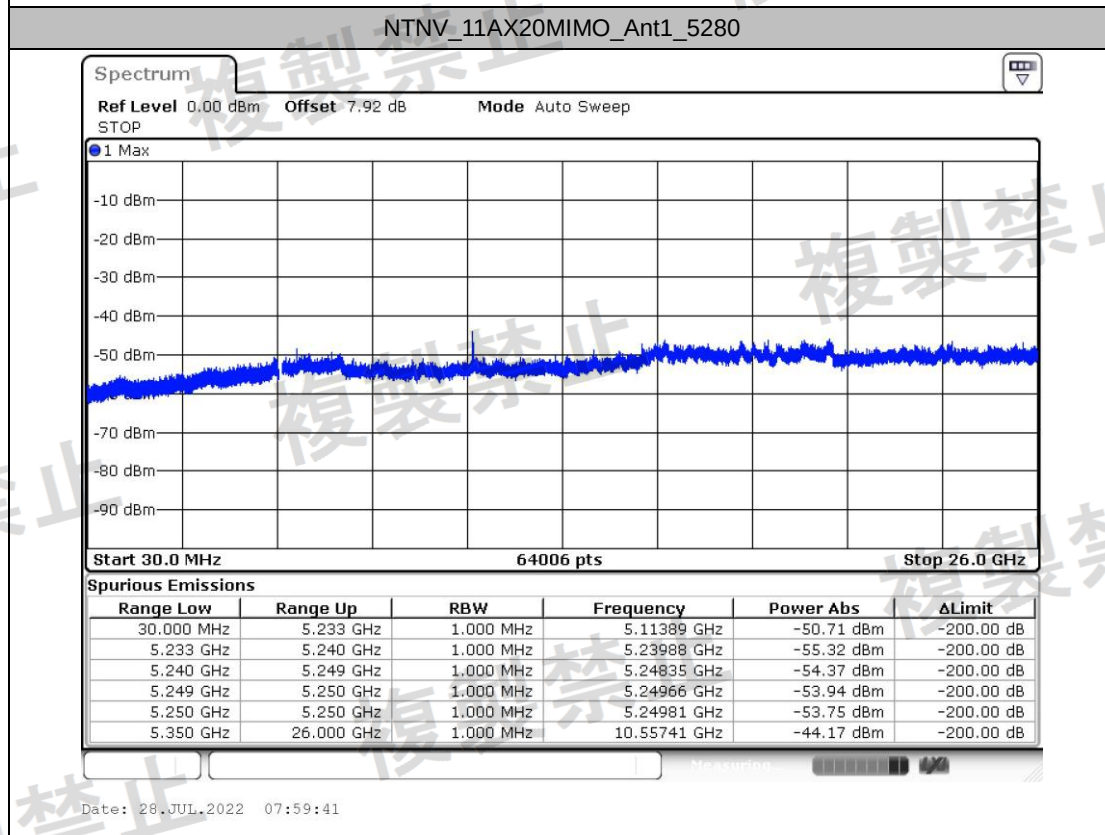
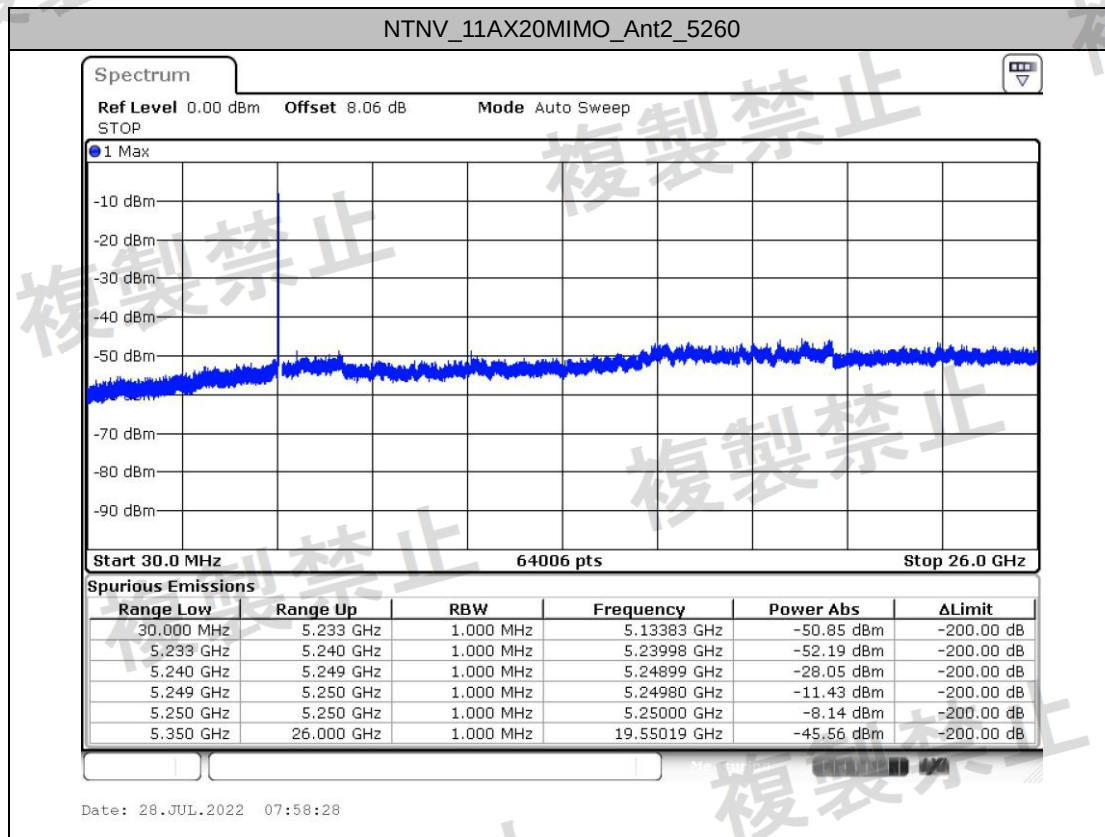


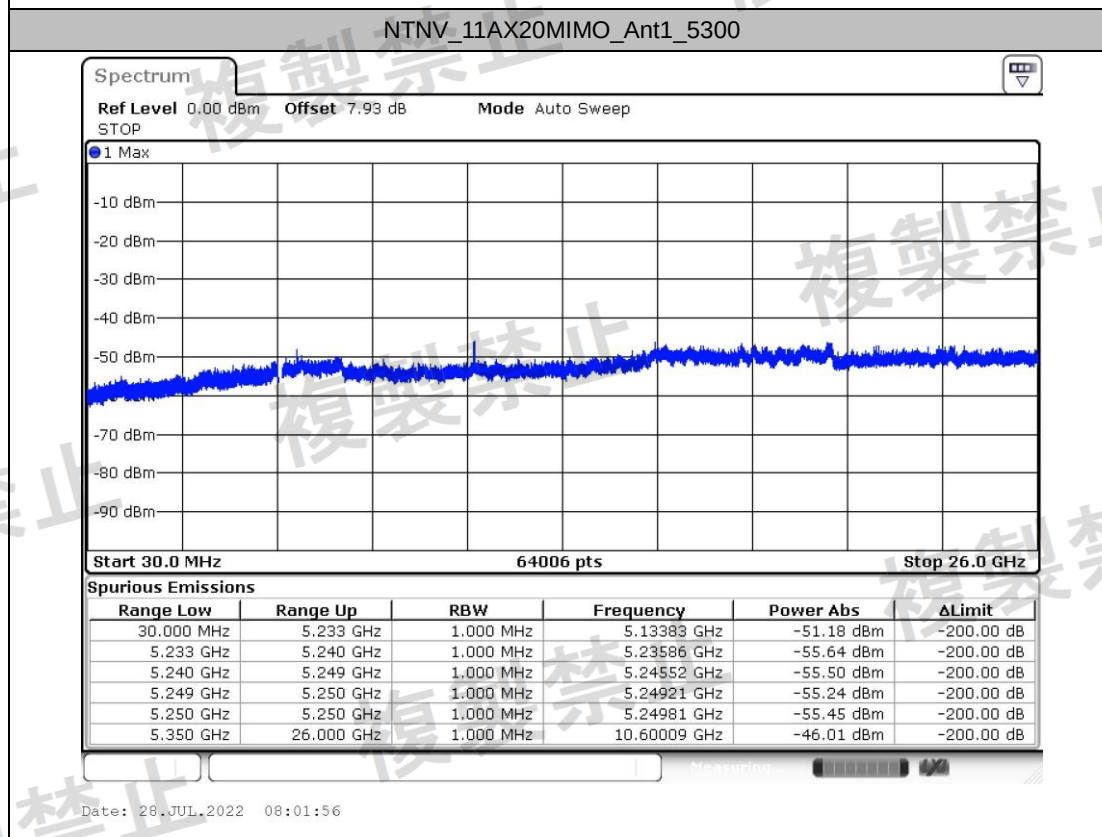
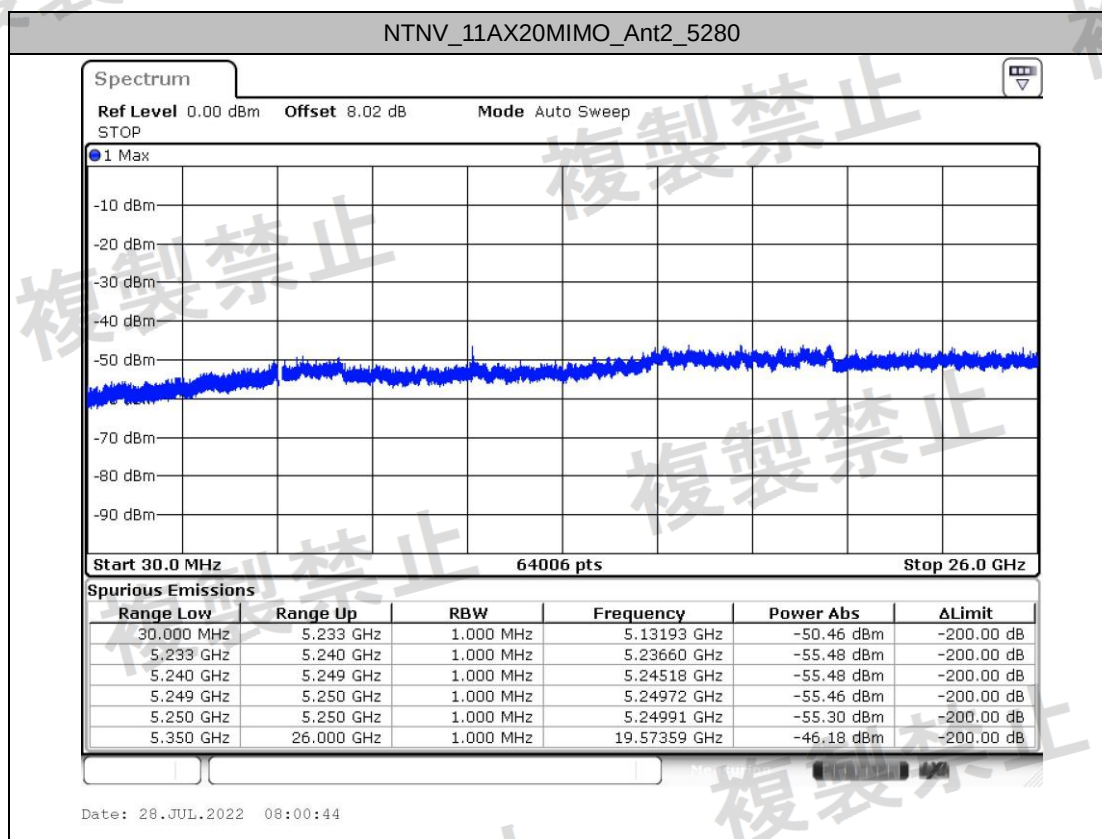


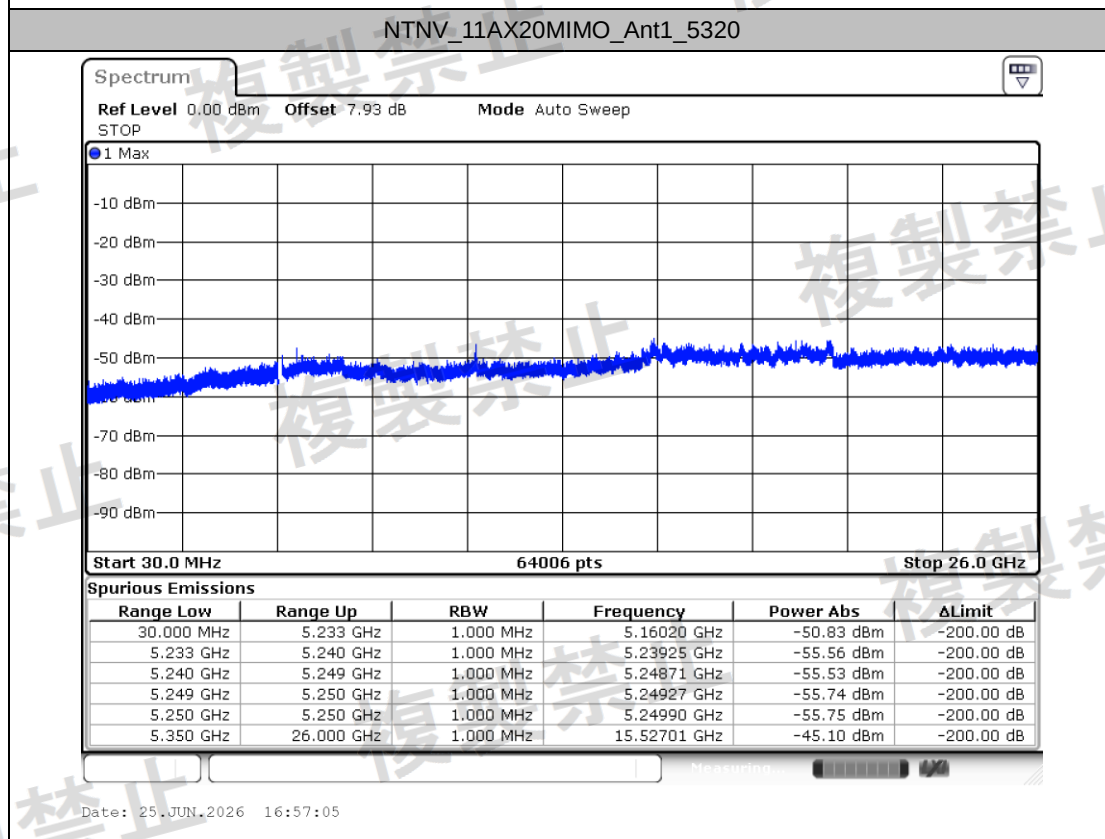
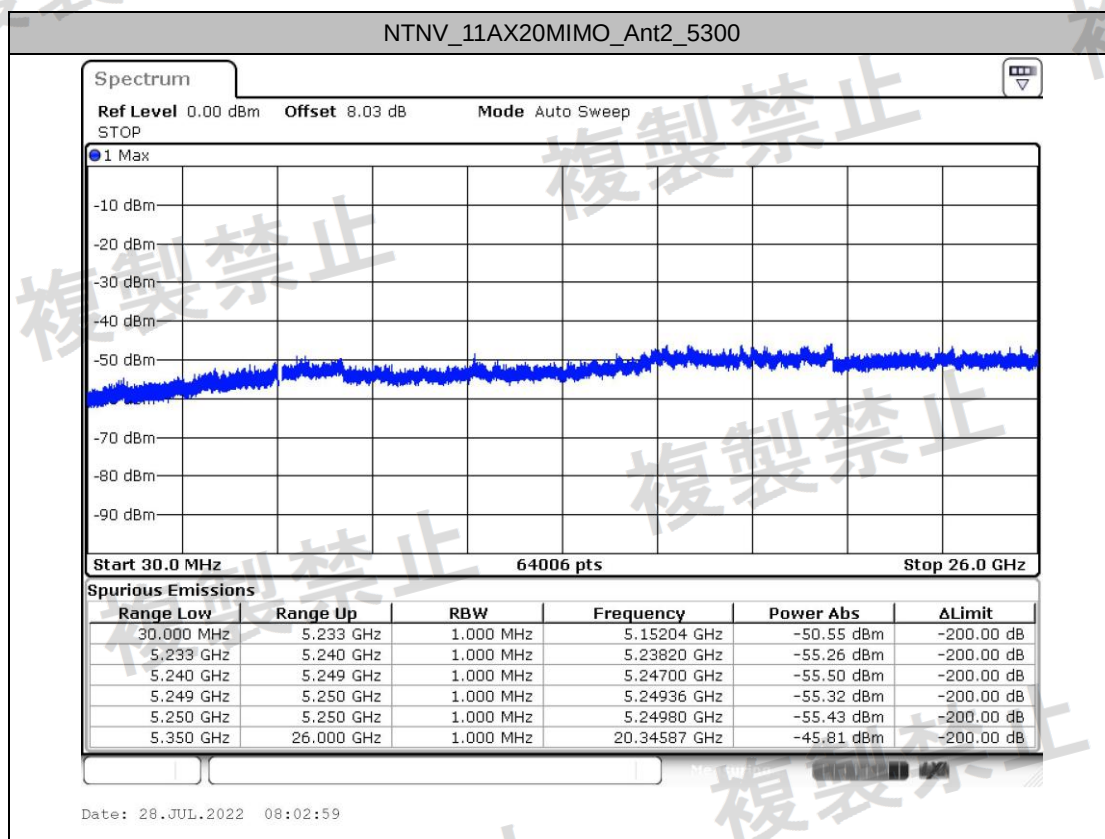


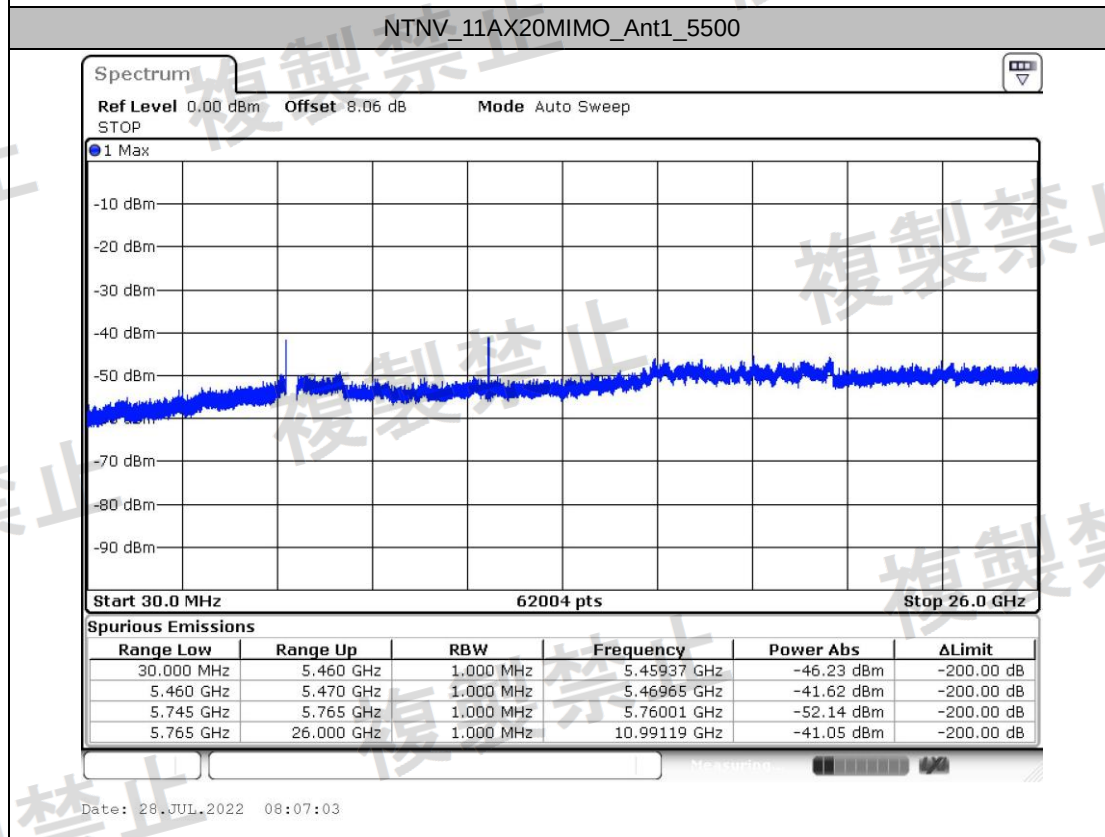
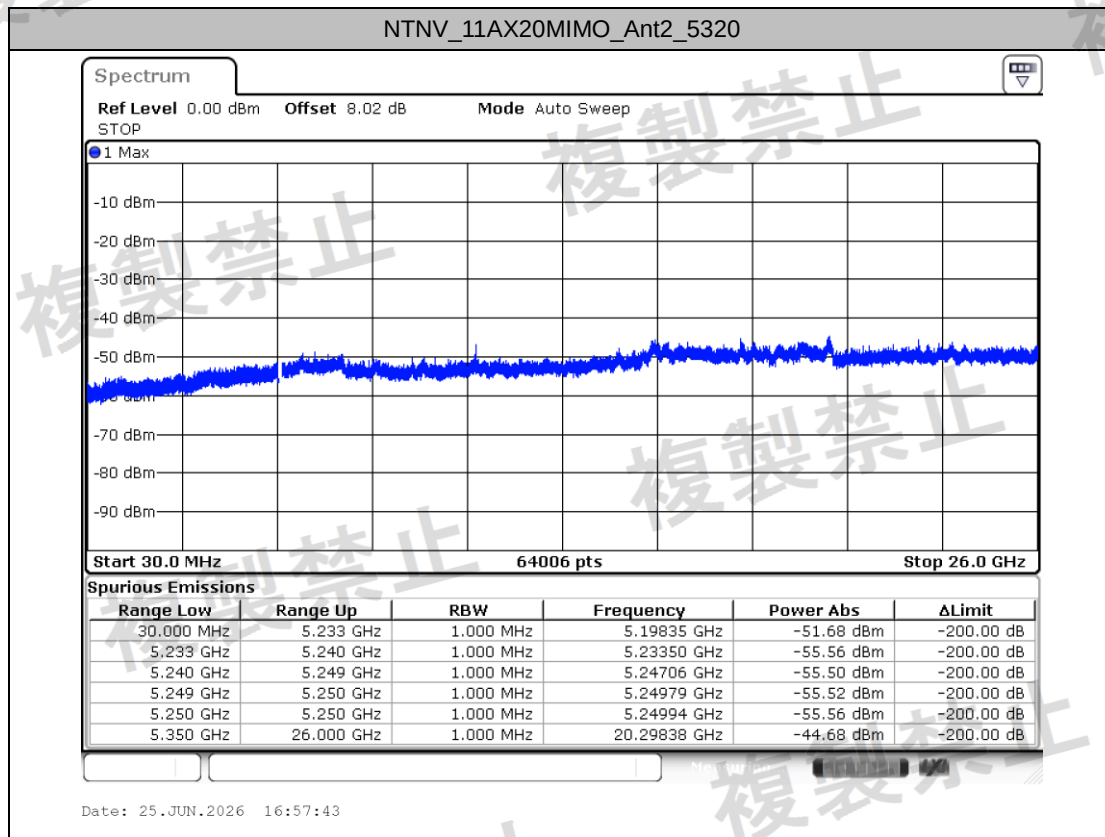


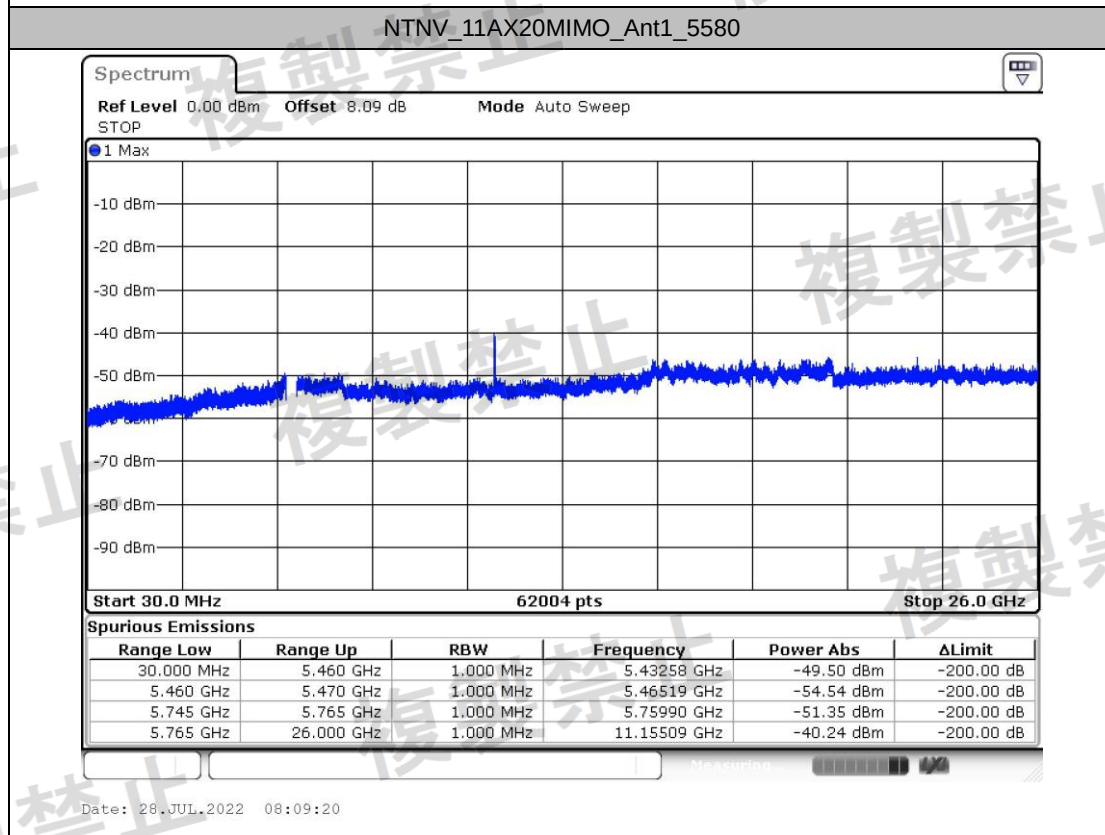
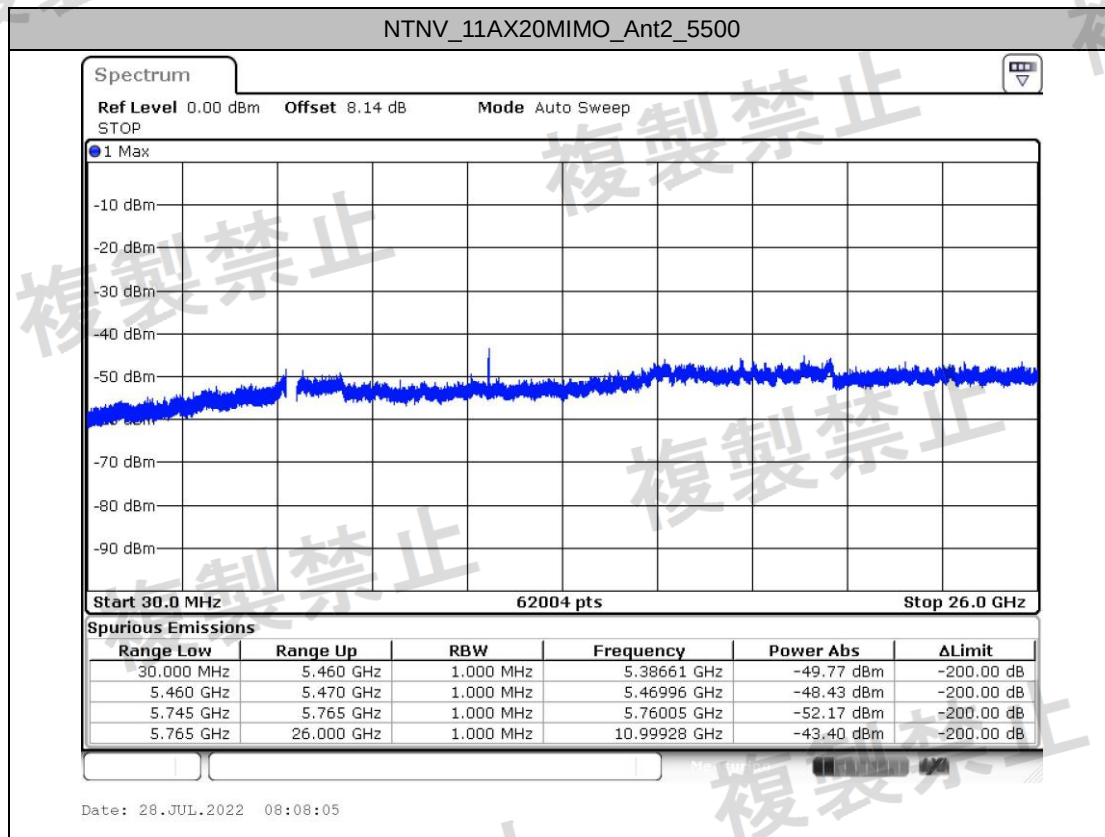


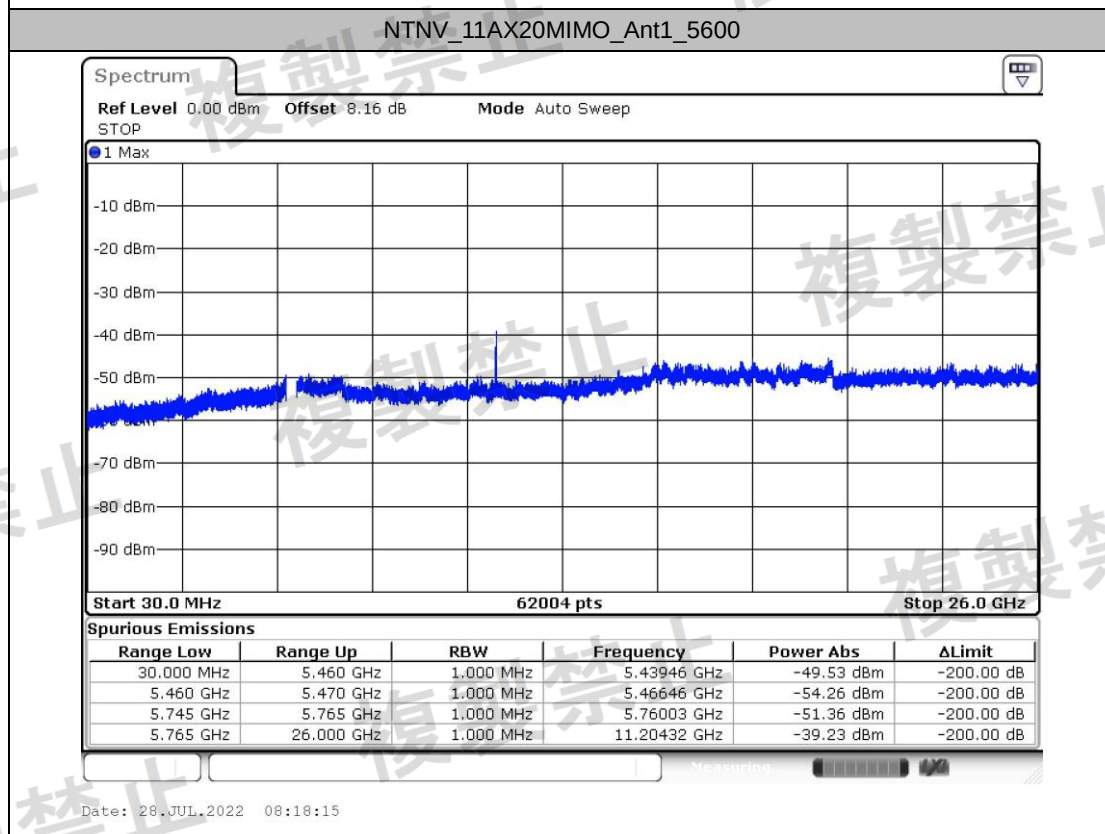
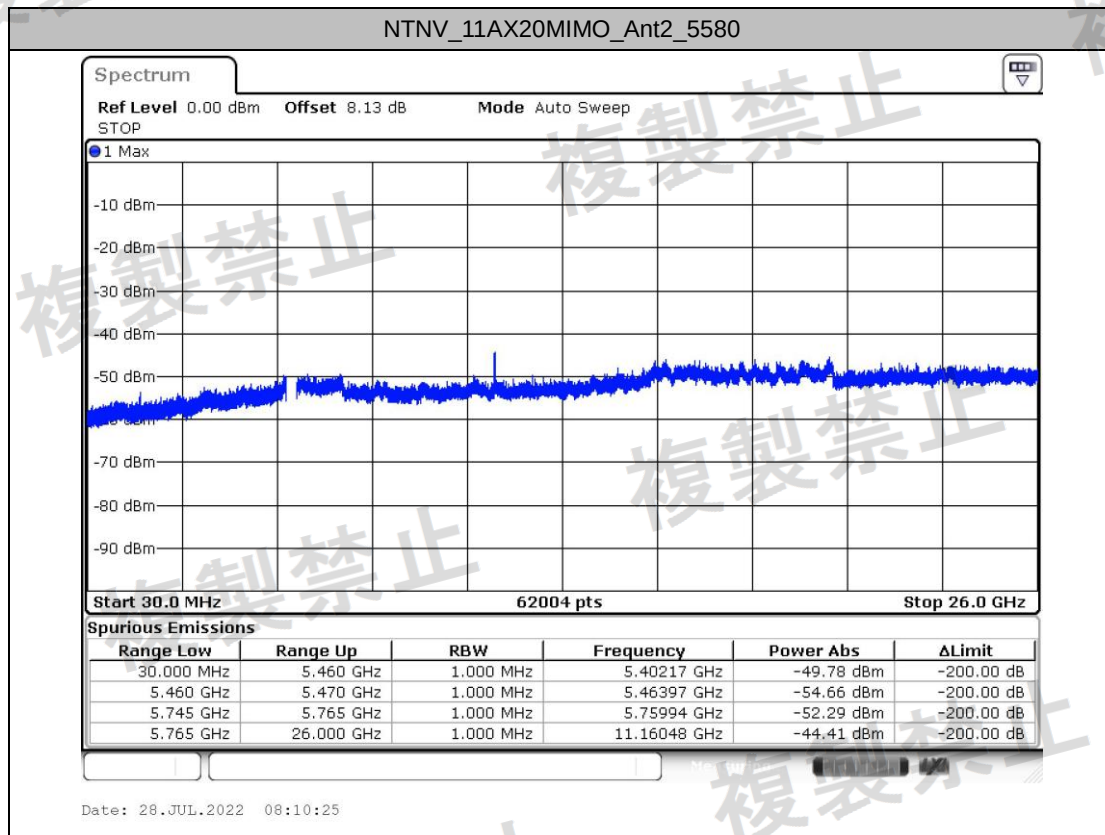


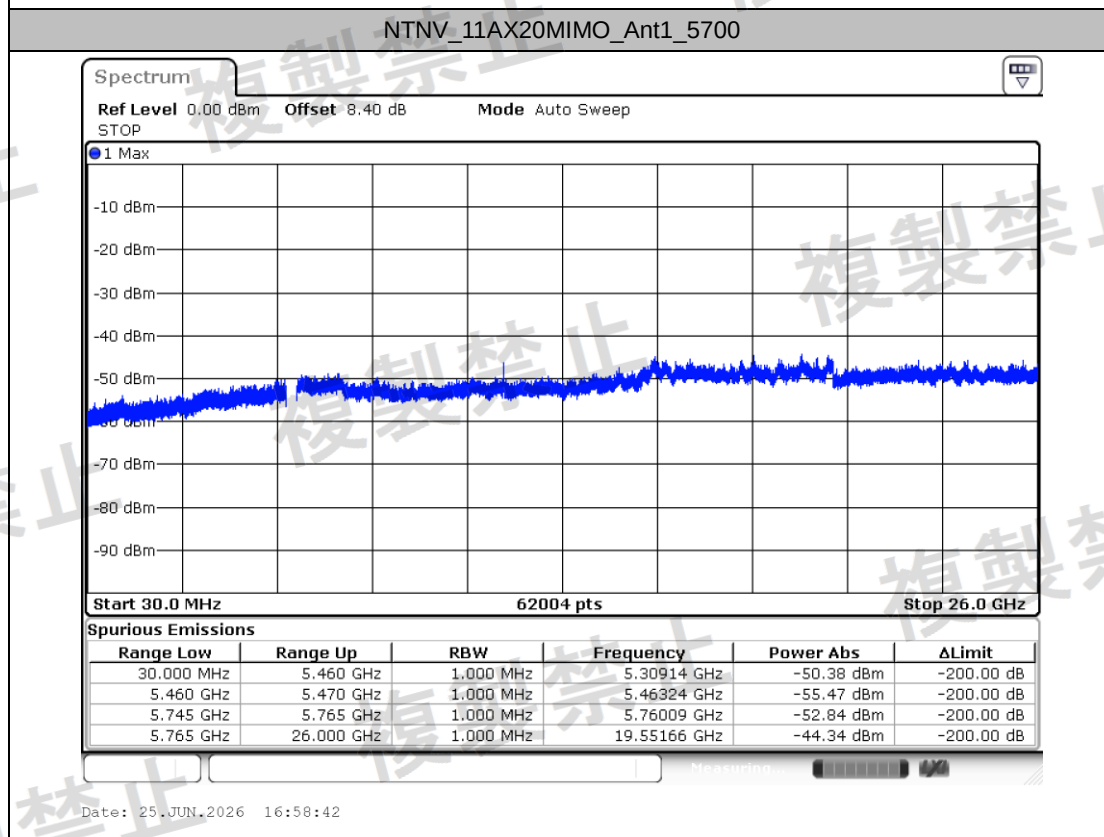
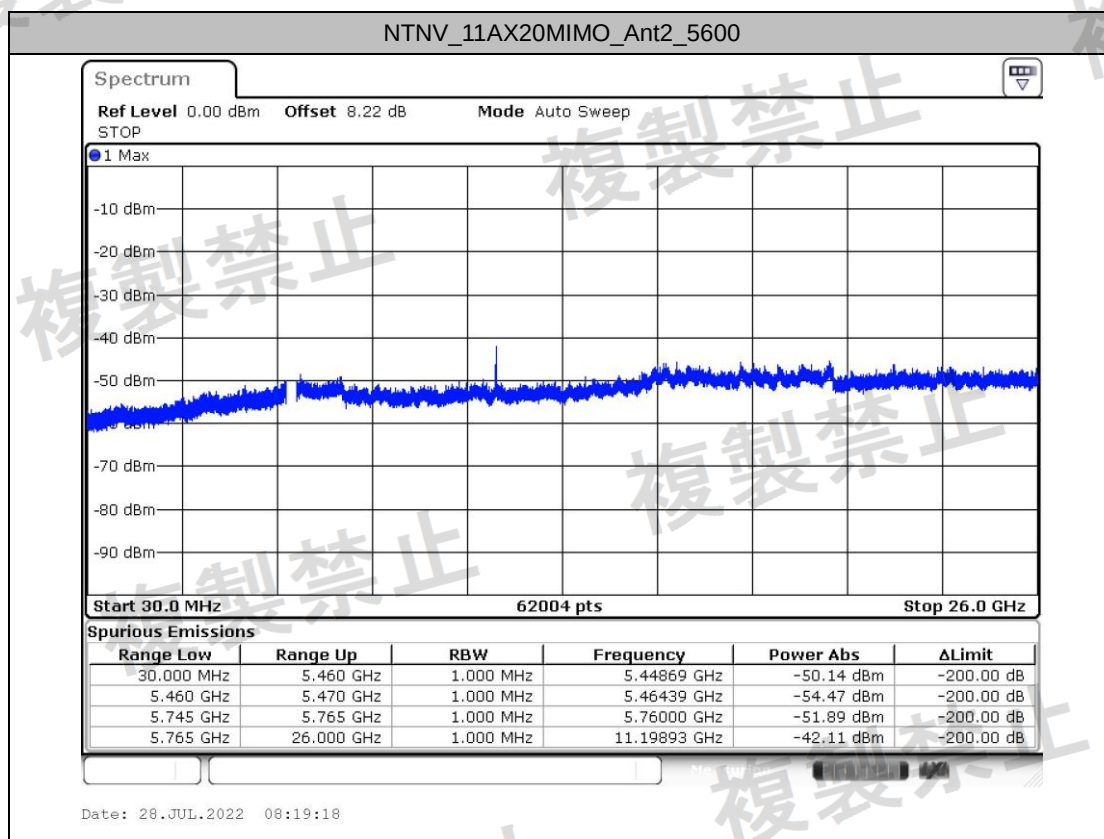


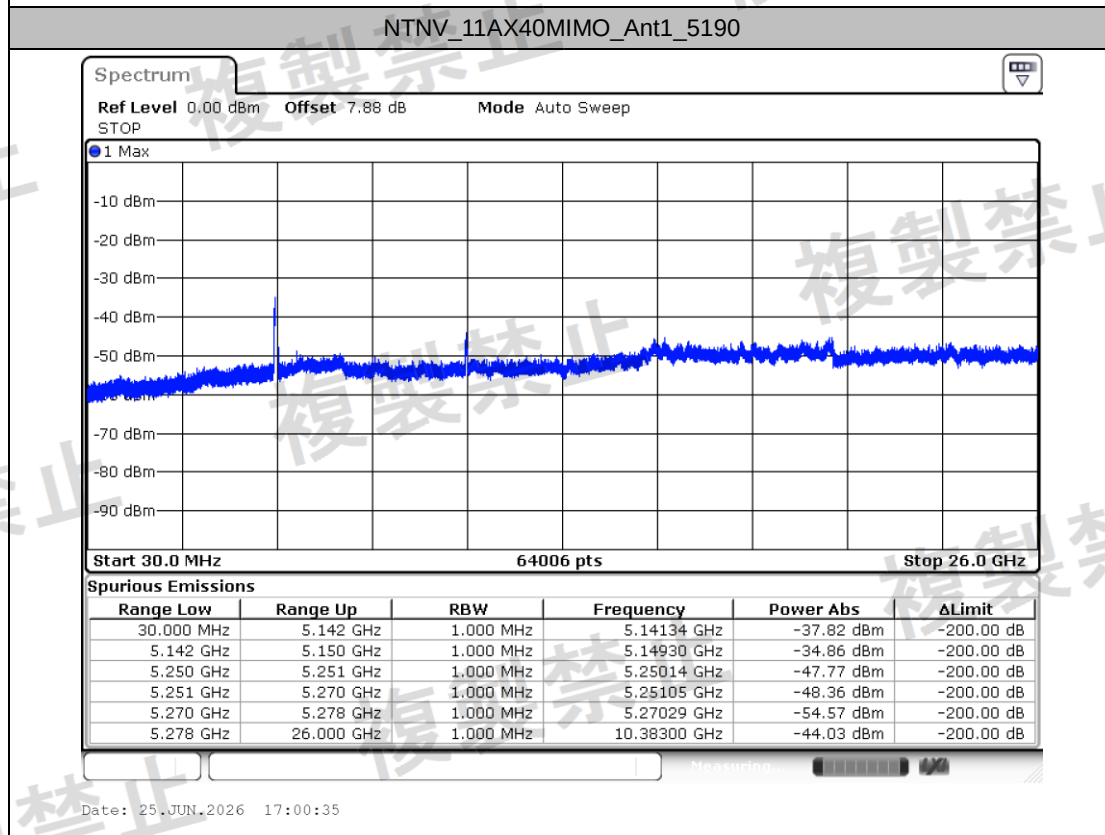
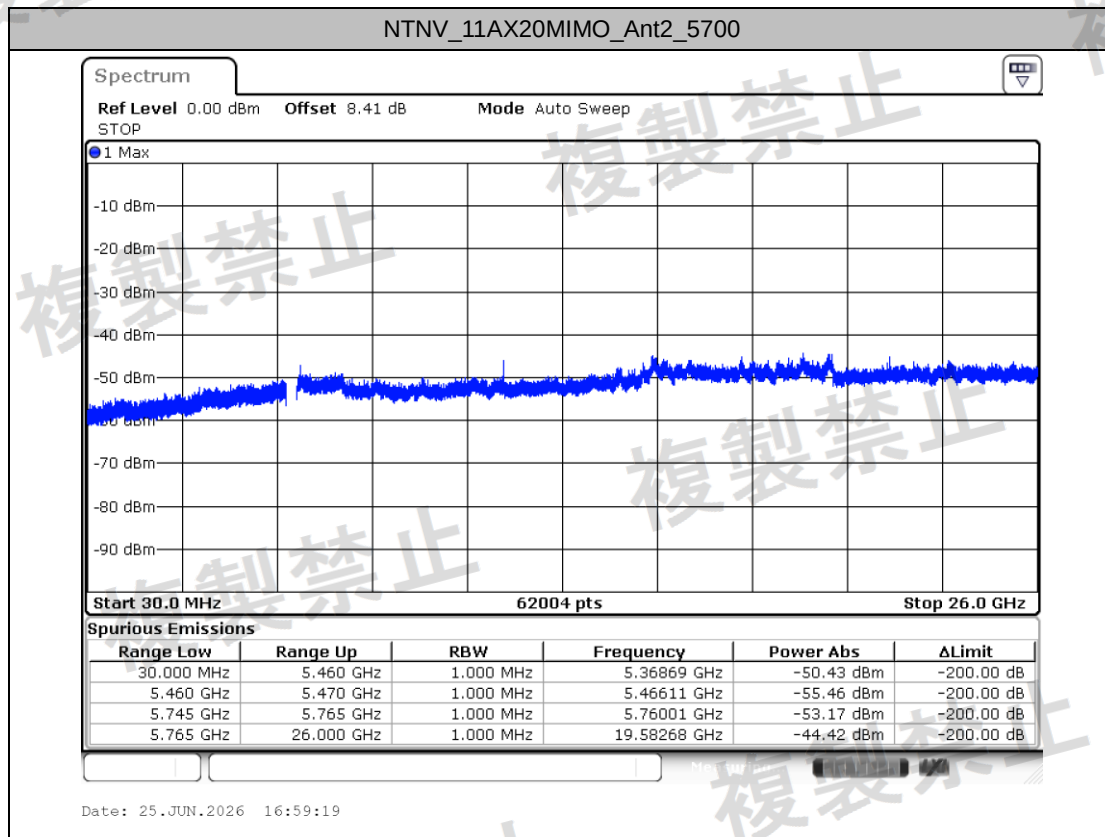


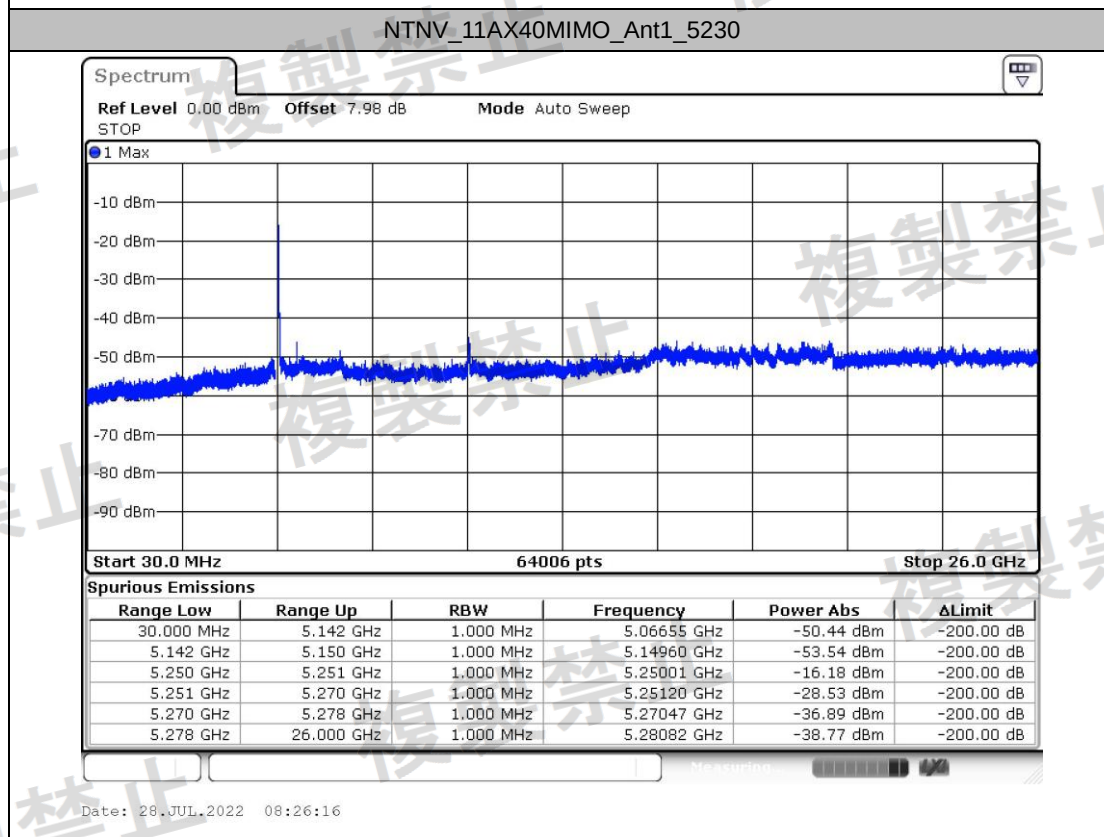
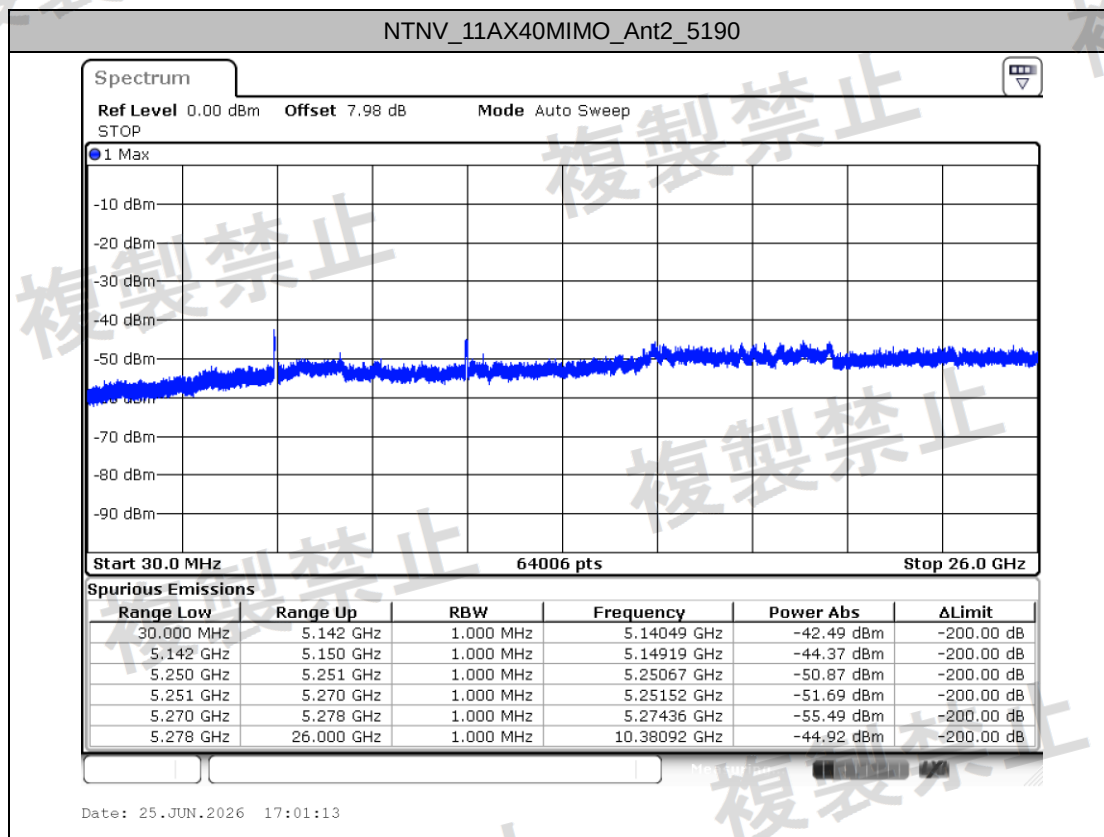


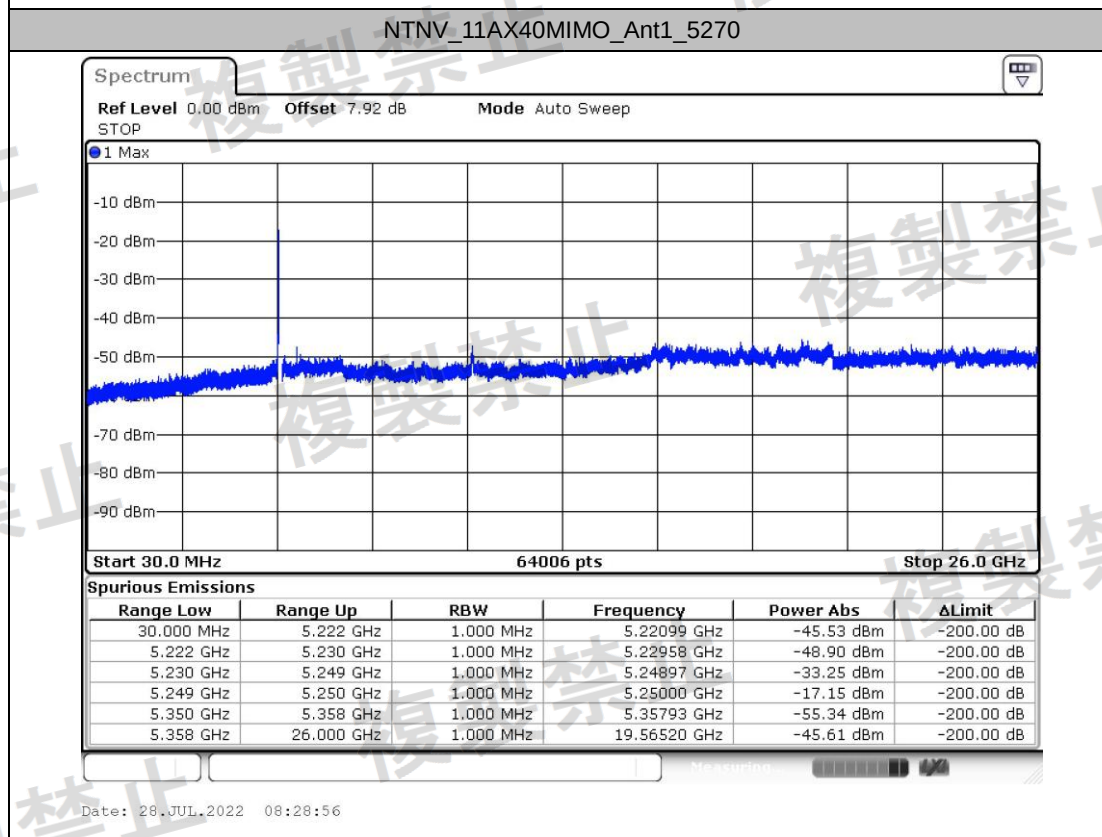
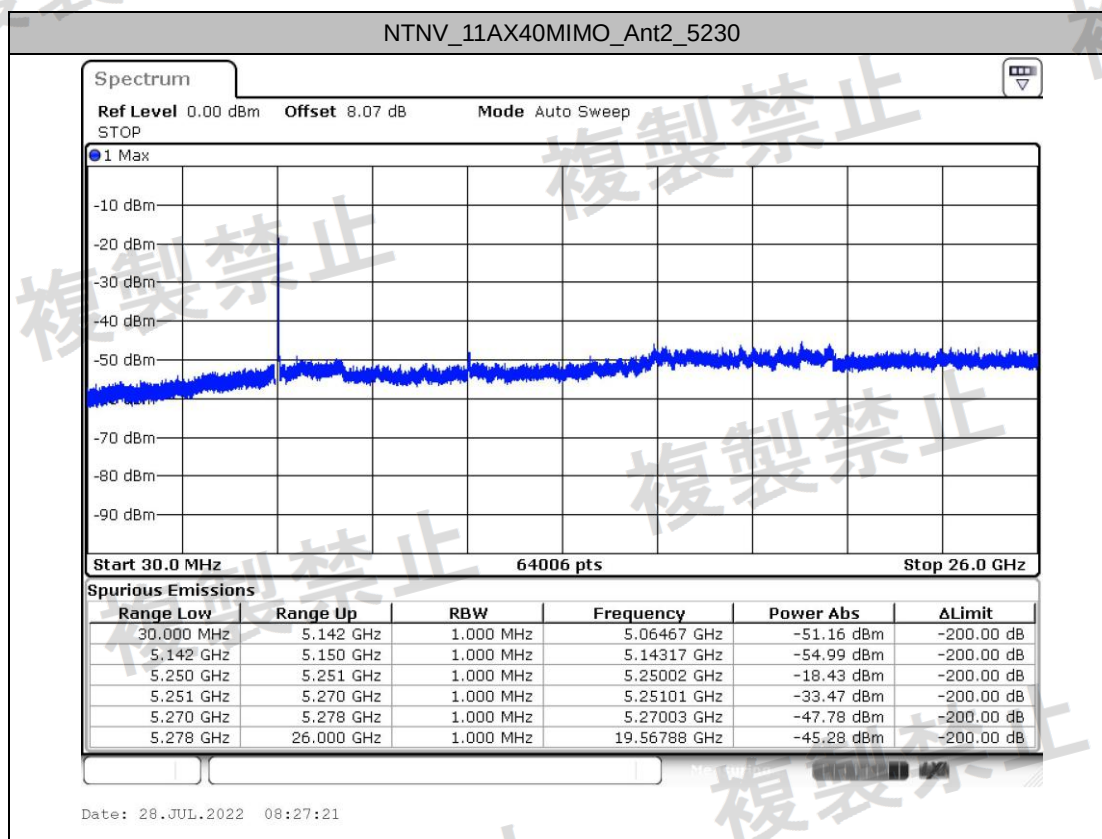


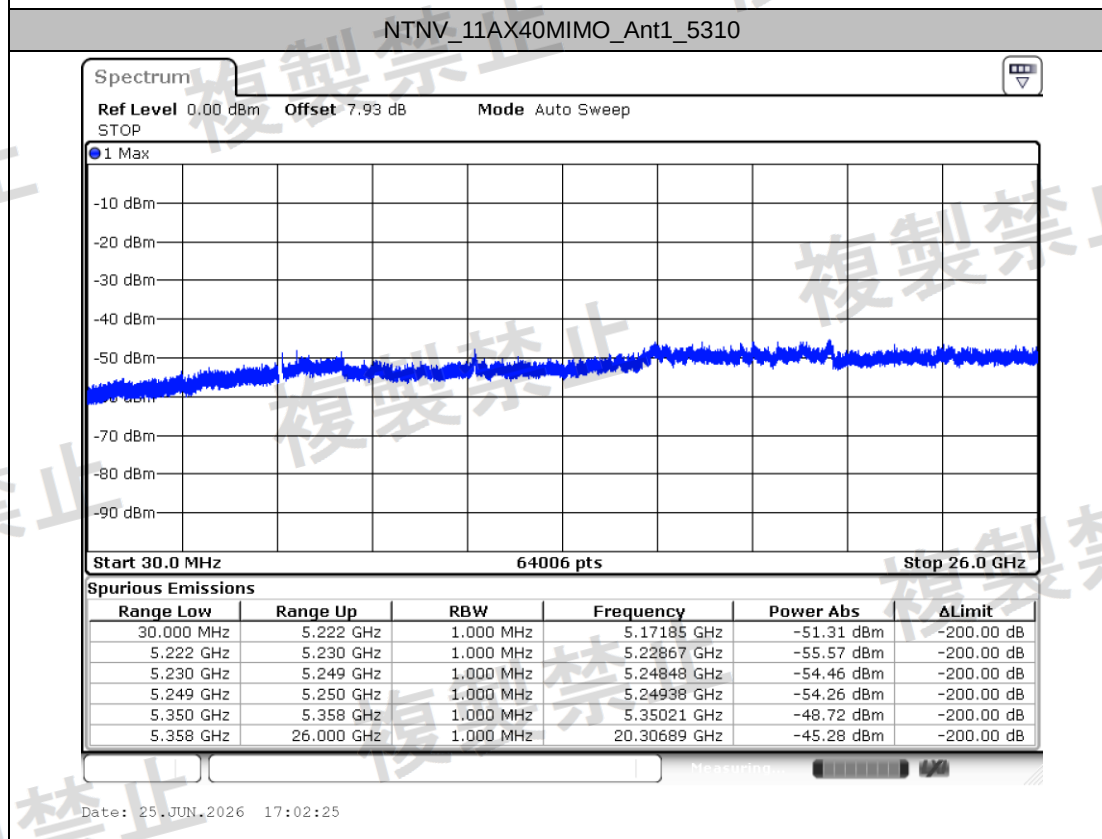
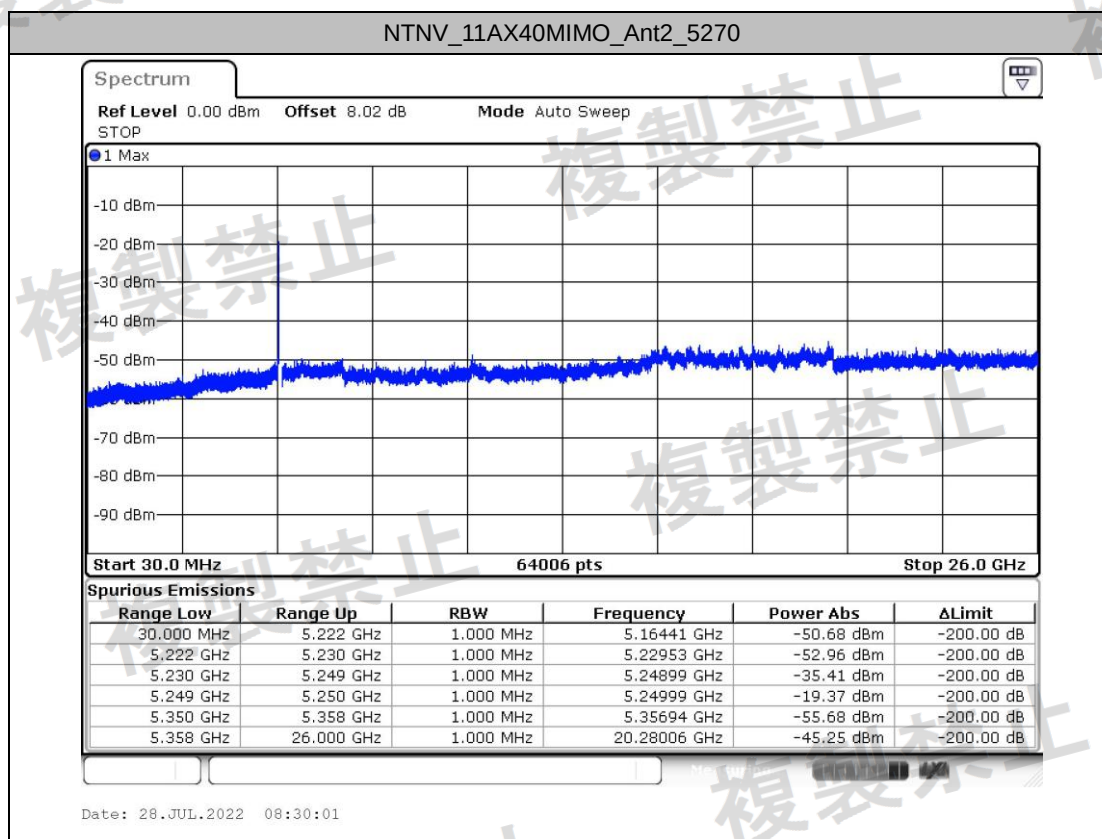


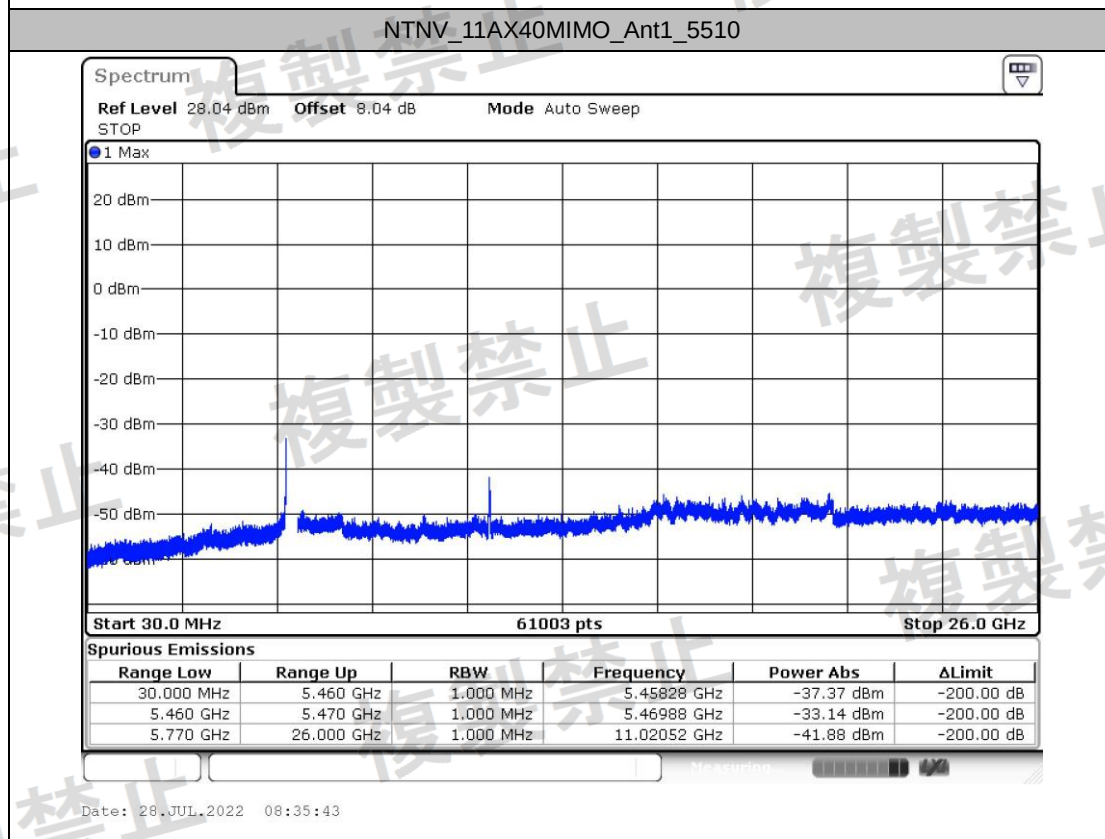
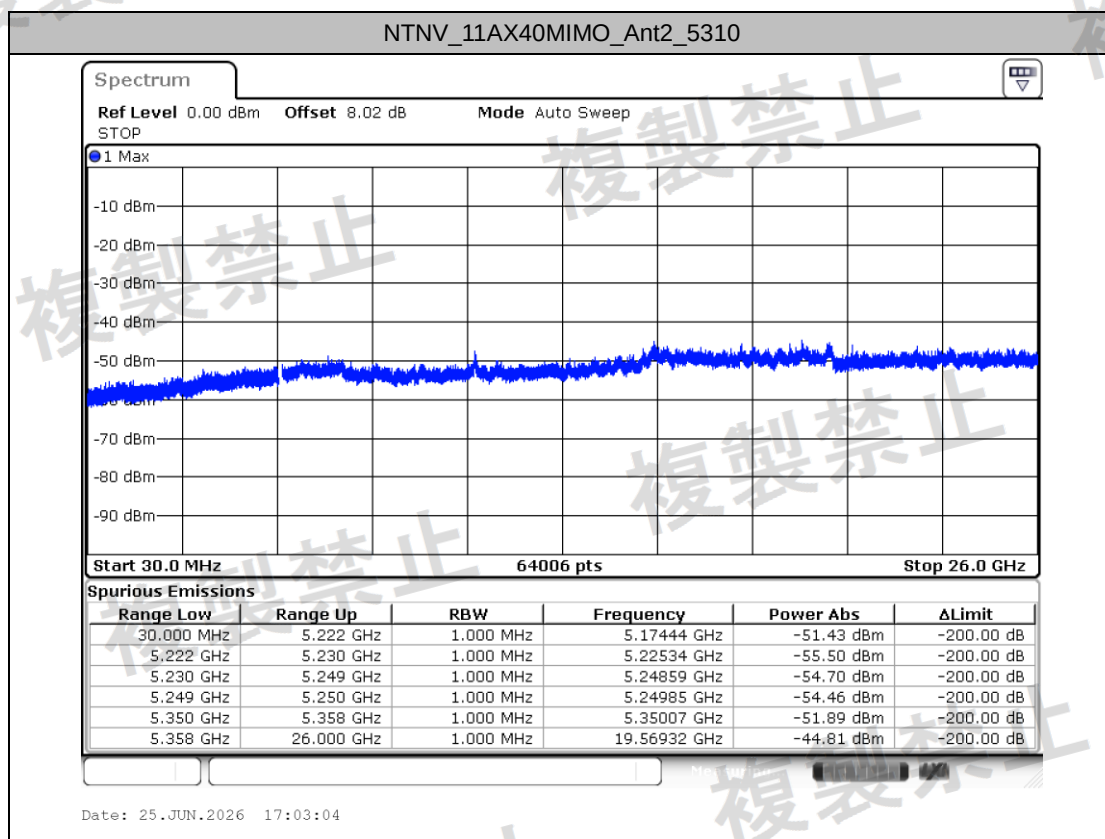


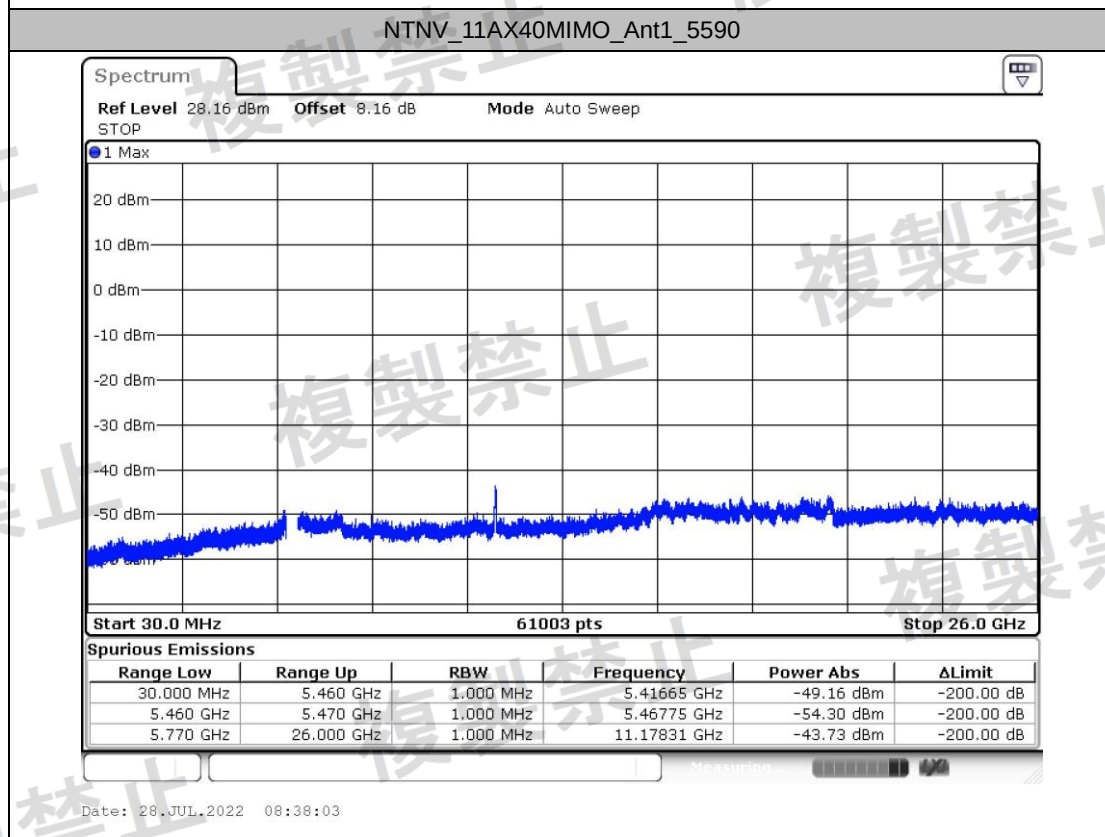
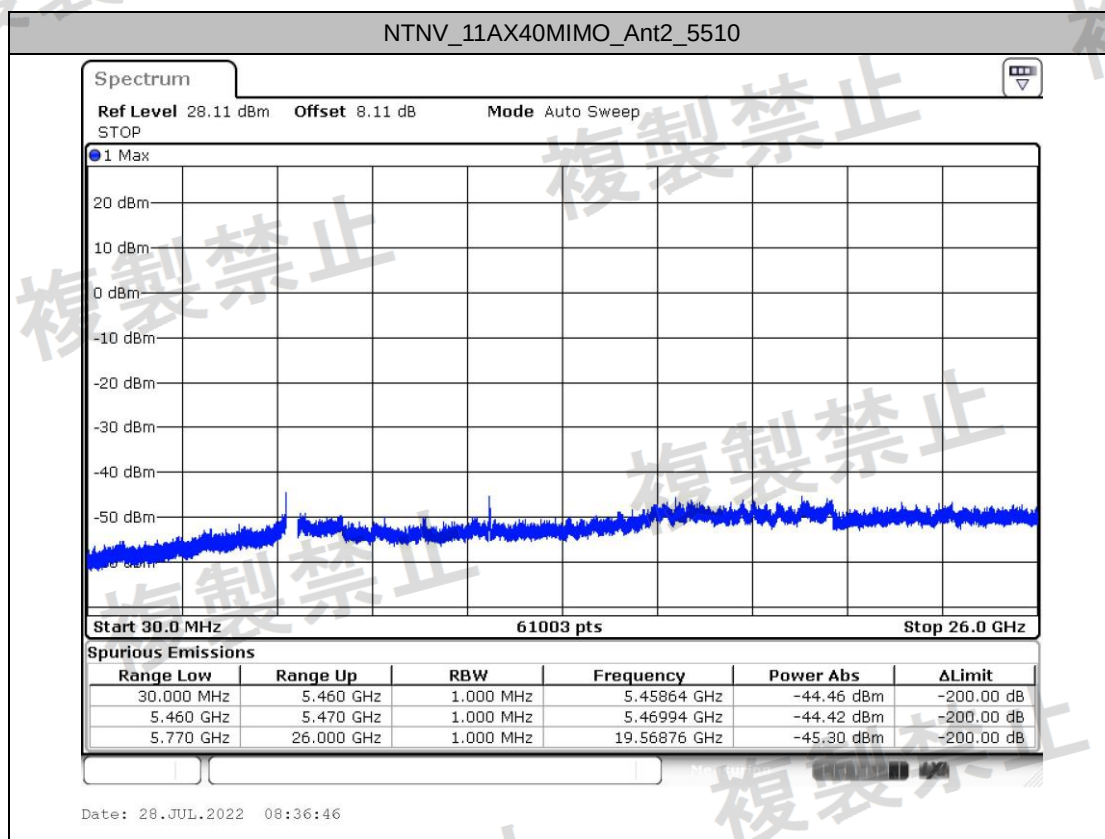


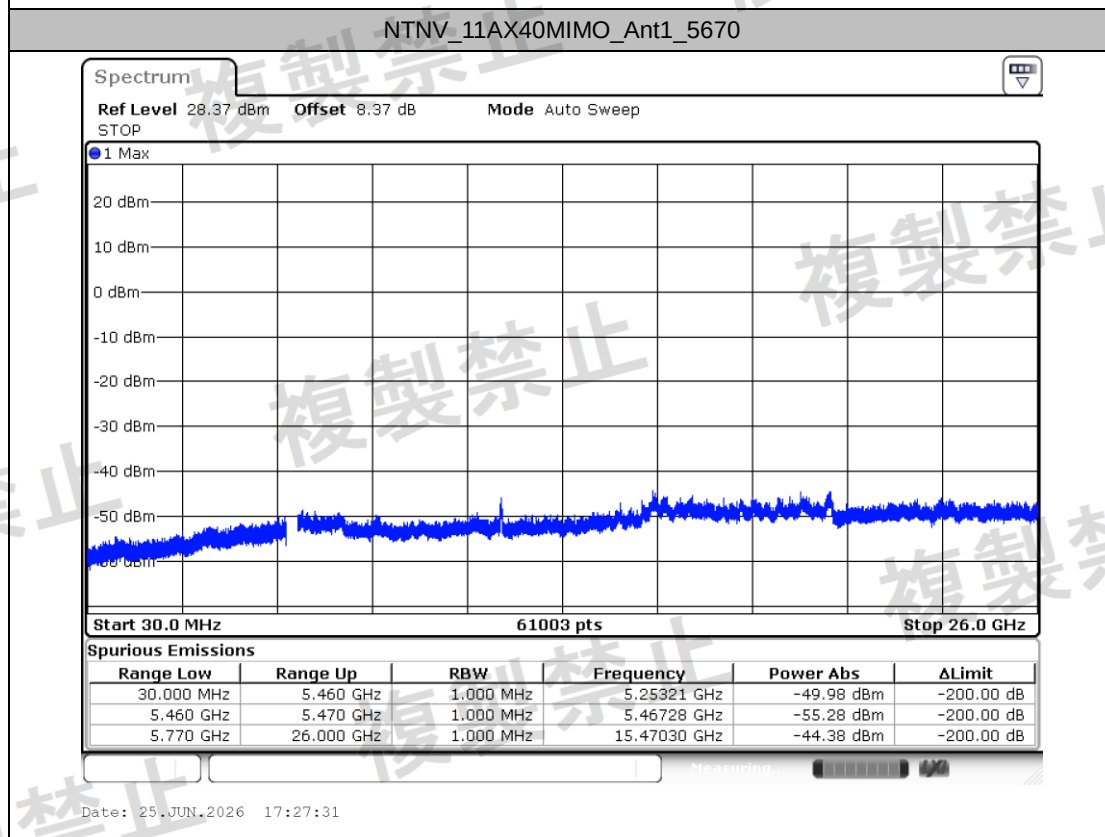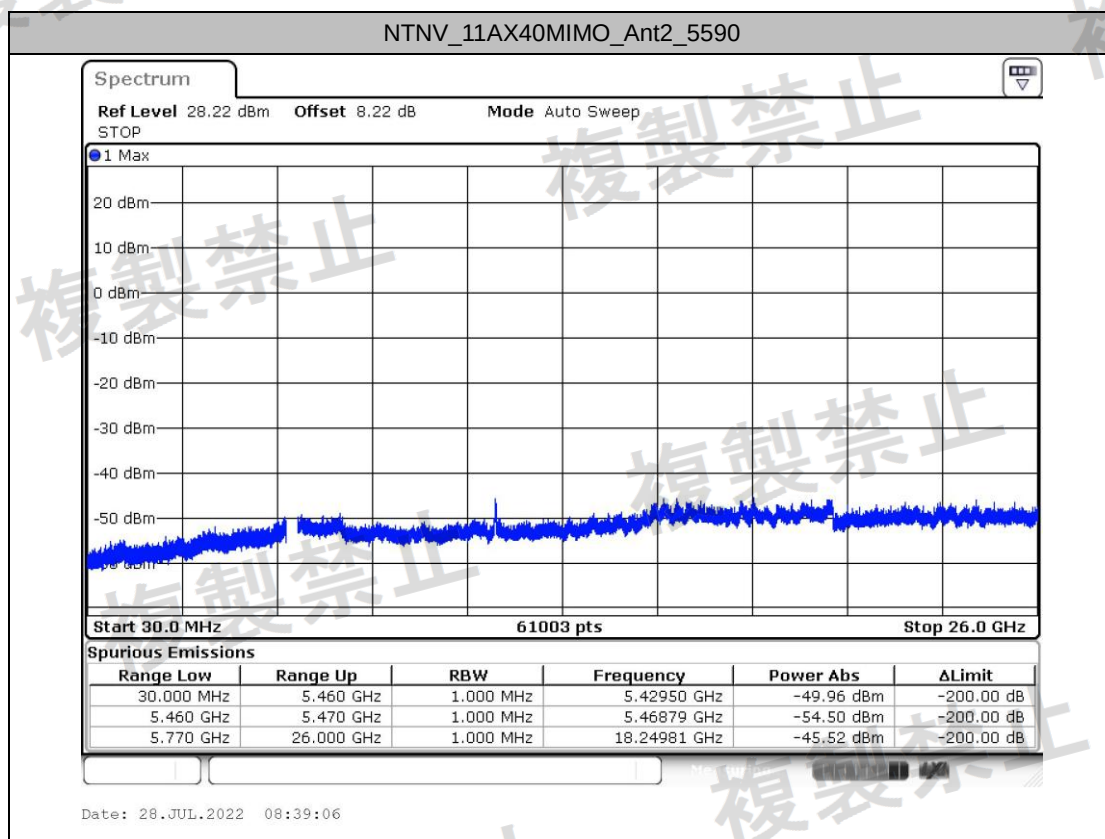


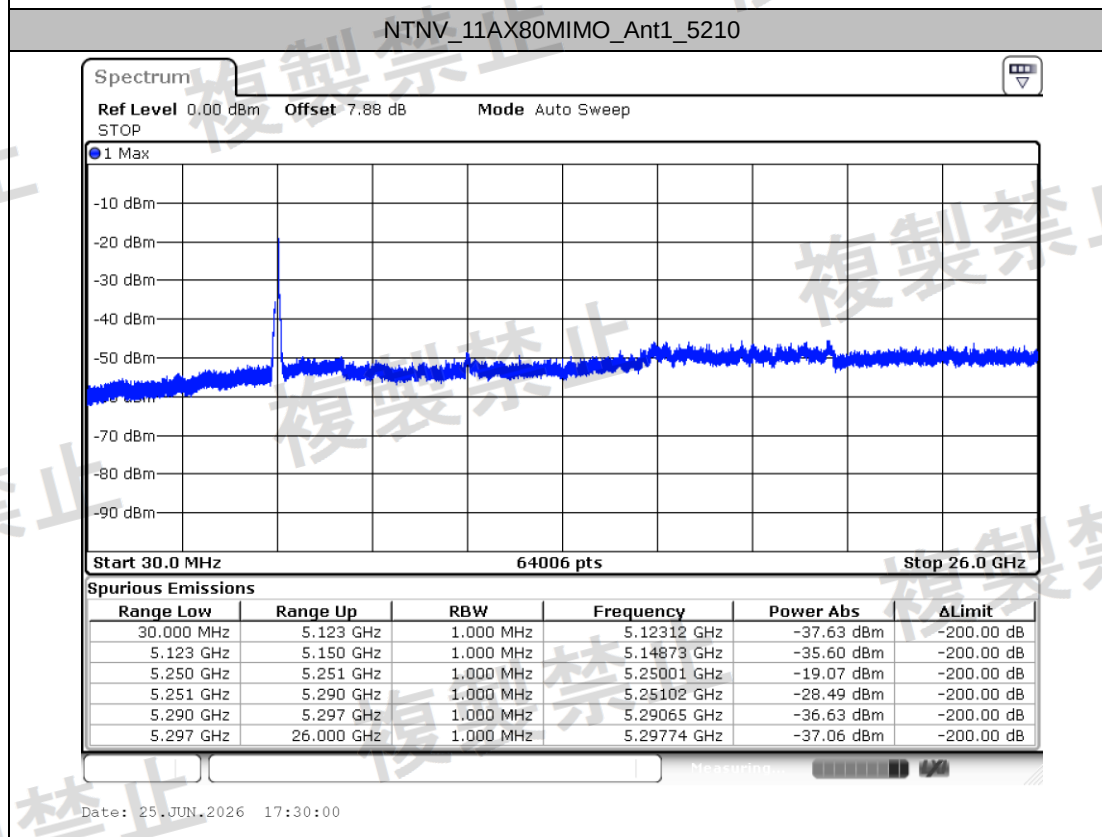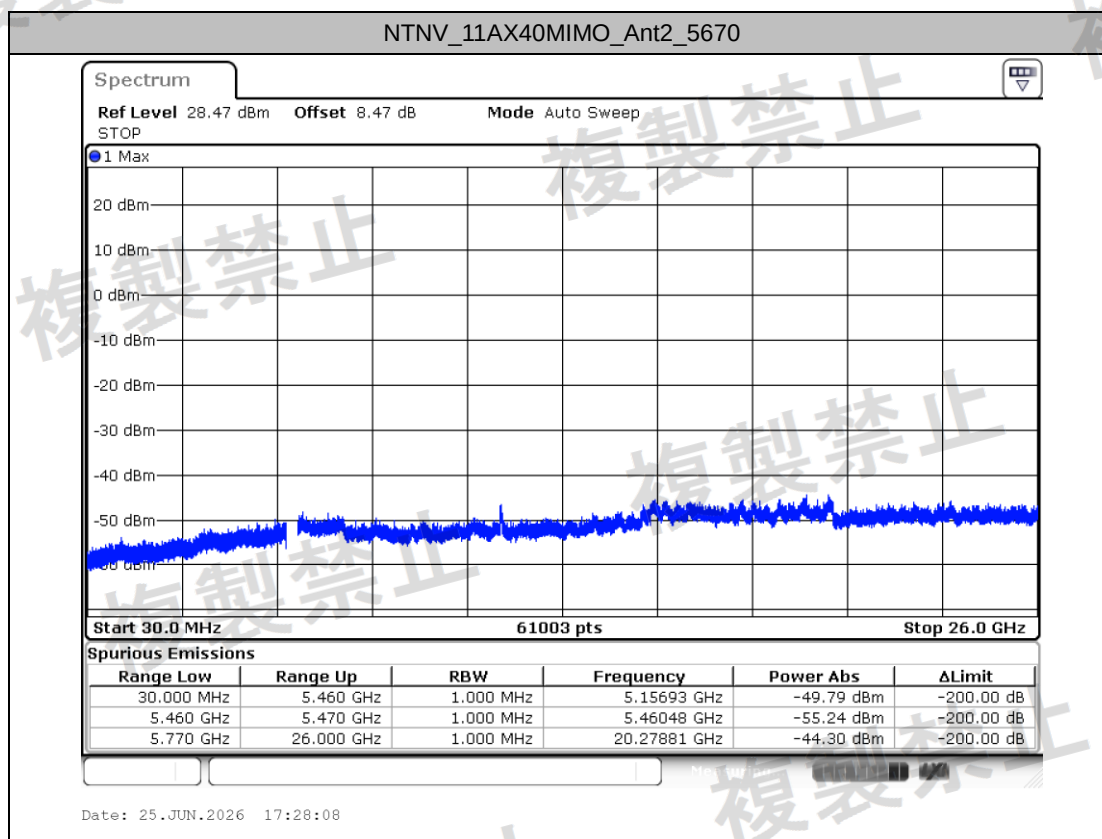

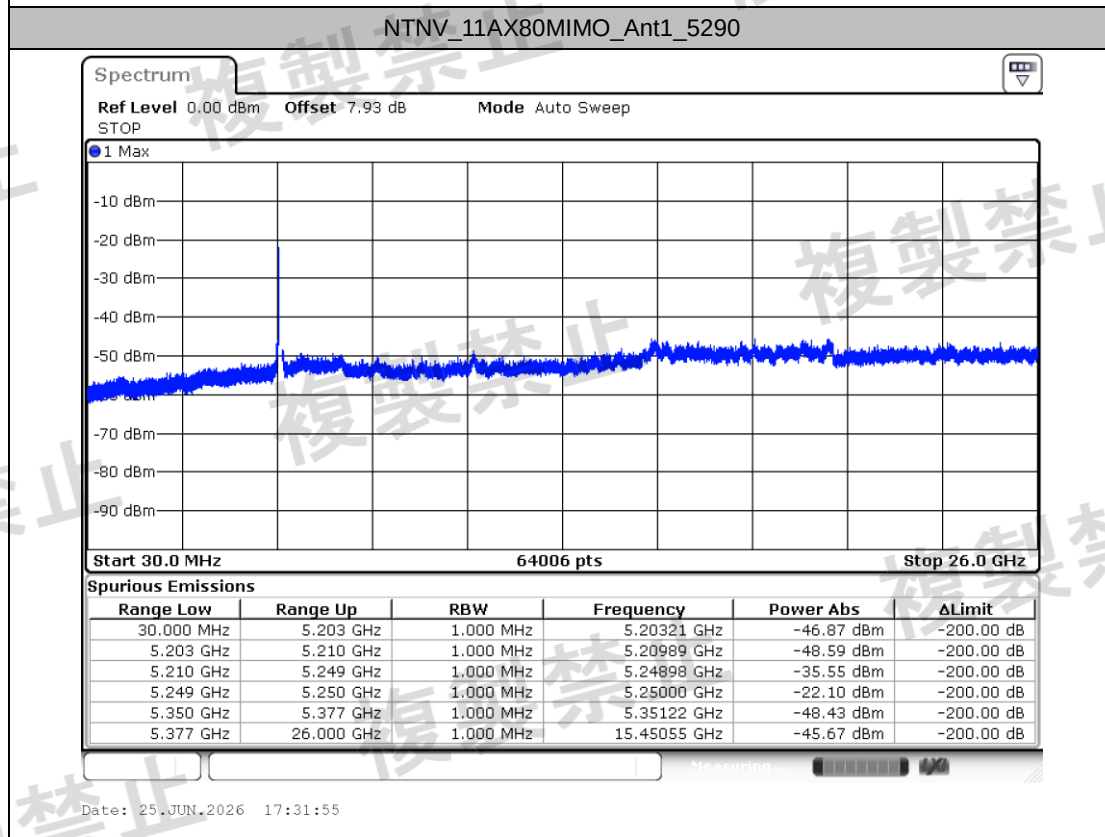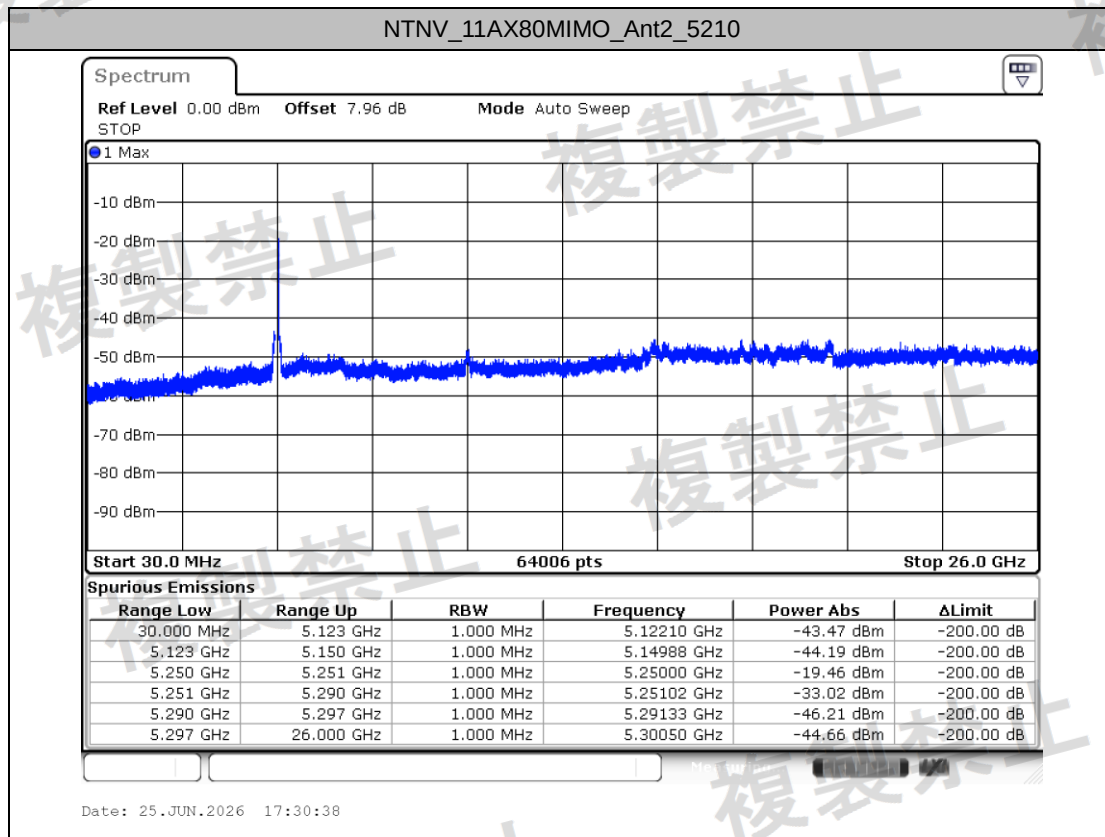

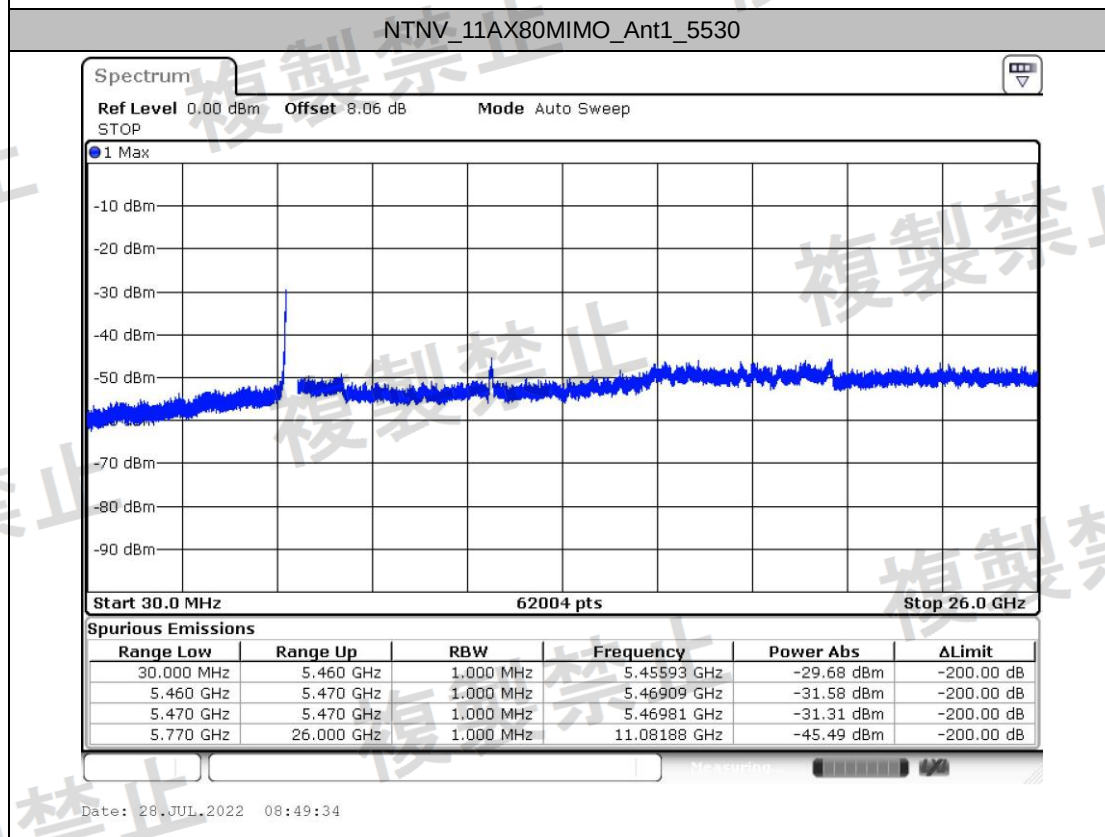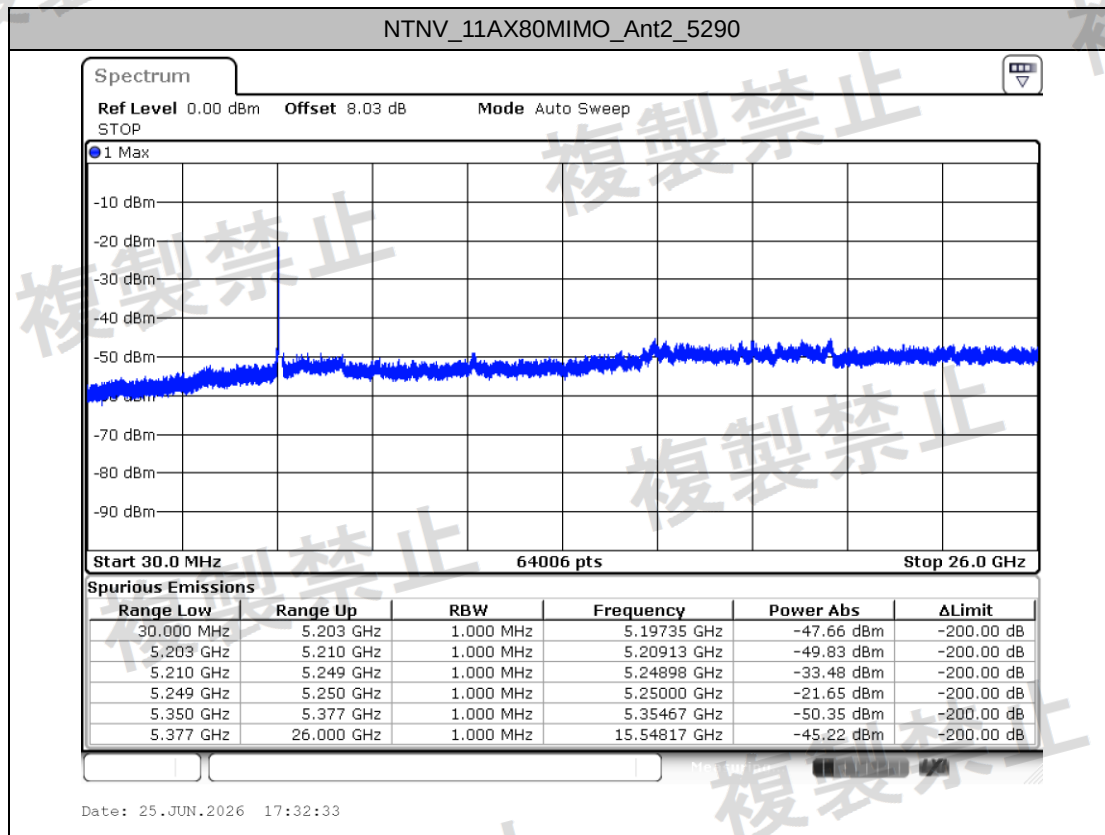

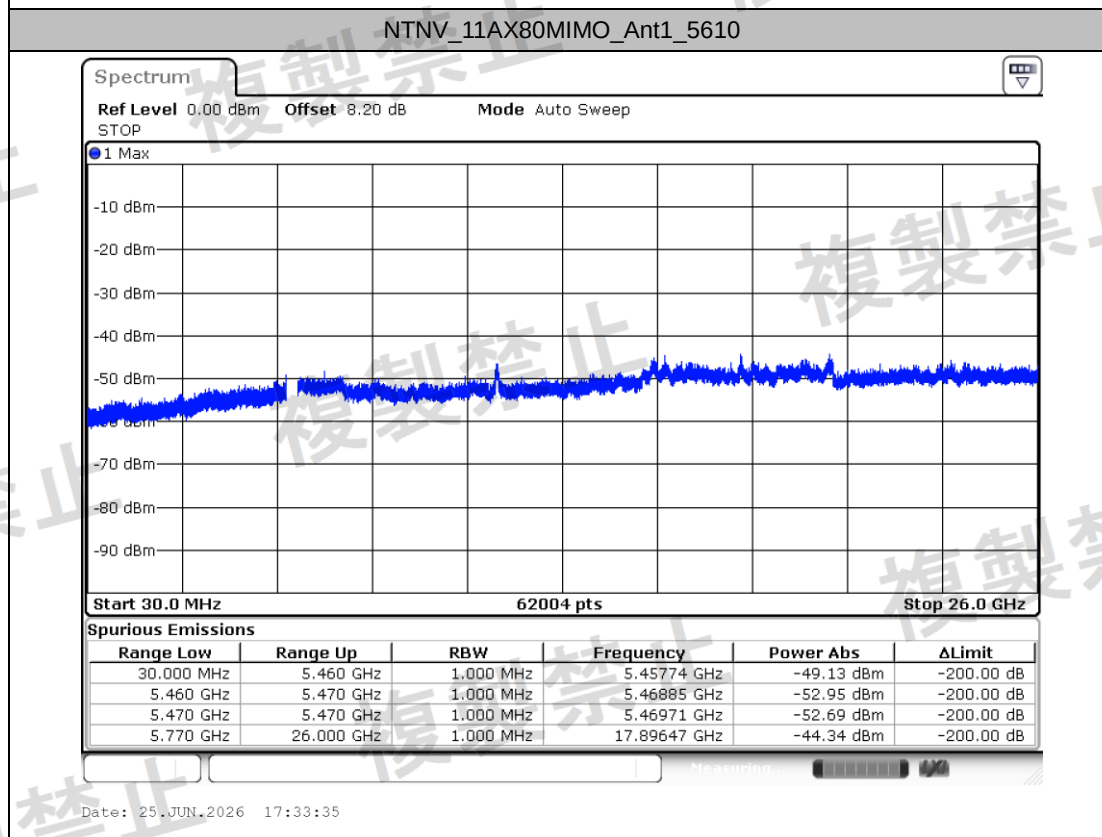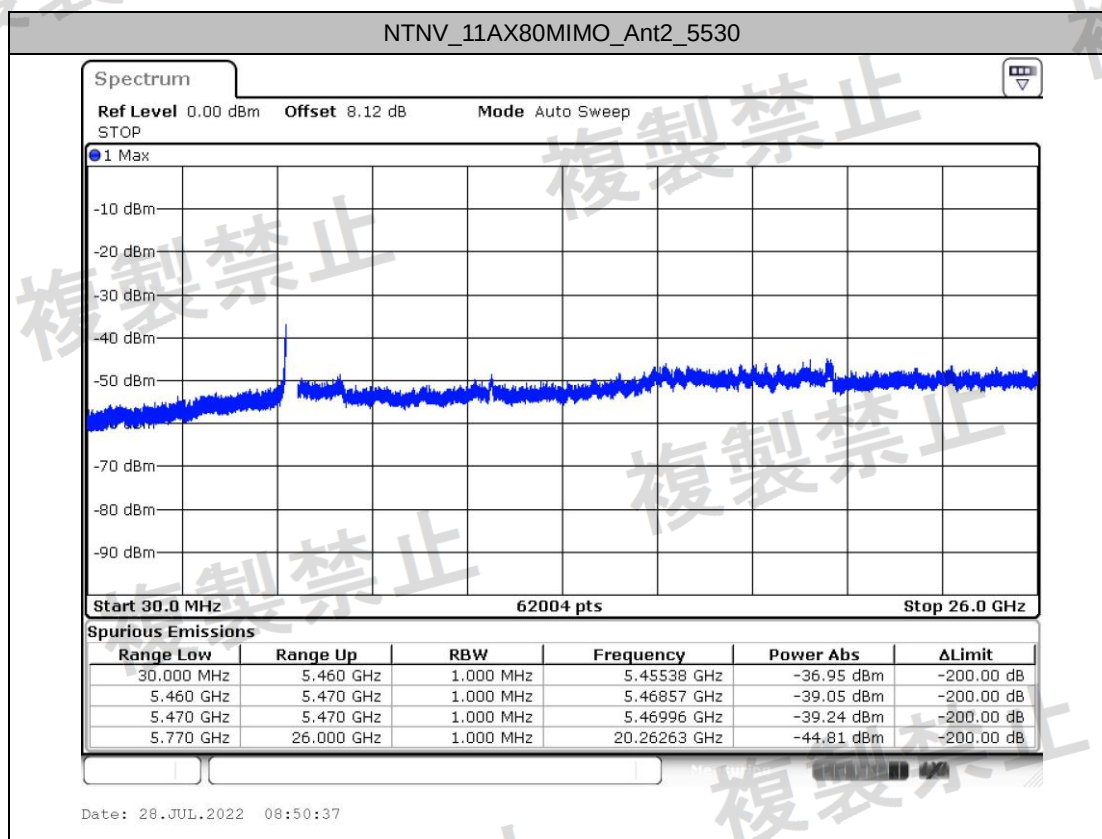

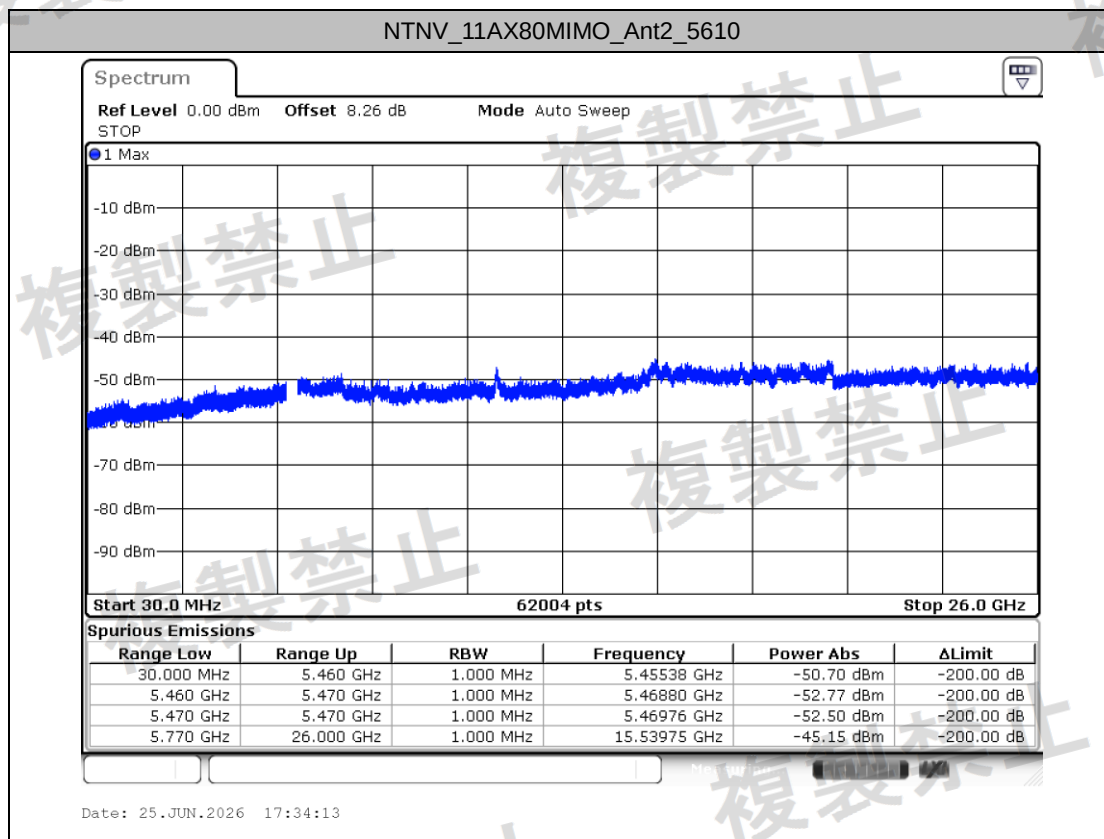



Secondarily emitted radio wave strength(RX)

Test Result

TestCondition	TestMode	Antenna	Freq (MHz)	Freq.Range [MHz]	Result [dBm]	Limit [dBm]	Result [nW]	Limit [nW]	Verdict
NTNV	11A-CDD	Ant1	5180	30~1000	-82.50	-54.00	0.00562	4	PASS
				1000~26000	-65.88	-47.00	0.25823	20	PASS
		Ant2	5180	30~1000	-81.90	-54.00	0.00646	4	PASS
				1000~26000	-65.82	-47.00	0.26182	20	PASS
		total	5180	30~1000	---	---	0.01208	4	PASS
				1000~26000	---	---	0.52005	20	PASS
		Ant1	5200	30~1000	-82.35	-54.00	0.00582	4	PASS
				1000~26000	-66.77	-47.00	0.21038	20	PASS
		Ant2	5200	30~1000	-82.95	-54.00	0.00507	4	PASS
				1000~26000	-66.53	-47.00	0.22233	20	PASS
		total	5200	30~1000	---	---	0.01089	4	PASS
				1000~26000	---	---	0.43271	20	PASS
		Ant1	5220	30~1000	-82.97	-54.00	0.00505	4	PASS
				1000~26000	-67.01	-47.00	0.19907	20	PASS
		Ant2	5220	30~1000	-82.36	-54.00	0.00581	4	PASS
				1000~26000	-66.79	-47.00	0.20941	20	PASS
		total	5220	30~1000	---	---	0.01086	4	PASS
				1000~26000	---	---	0.40848	20	PASS
		Ant1	5240	30~1000	-82.52	-54.00	0.00560	4	PASS
				1000~26000	-66.53	-47.00	0.22233	20	PASS
		Ant2	5240	30~1000	-83.03	-54.00	0.00498	4	PASS
				1000~26000	-66.97	-47.00	0.20091	20	PASS
		total	5240	30~1000	---	---	0.01058	4	PASS
				1000~26000	---	---	0.42324	20	PASS
		Ant1	5260	30~1000	-82.51	-54.00	0.00561	4	PASS
				1000~26000	-66.45	-47.00	0.22646	20	PASS
		Ant2	5260	30~1000	-82.74	-54.00	0.00532	4	PASS
				1000~26000	-66.74	-47.00	0.21184	20	PASS
		total	5260	30~1000	---	---	0.01093	4	PASS
				1000~26000	---	---	0.43830	20	PASS
		Ant1	5280	30~1000	-83.32	-54.00	0.00466	4	PASS
				1000~26000	-66.59	-47.00	0.21928	20	PASS
		Ant2	5280	30~1000	-82.67	-54.00	0.00541	4	PASS
				1000~26000	-66.88	-47.00	0.20512	20	PASS
		total	5280	30~1000	---	---	0.01007	4	PASS
				1000~26000	---	---	0.42440	20	PASS
		Ant1	5300	30~1000	-82.63	-54.00	0.00546	4	PASS
				1000~26000	-66.80	-47.00	0.20893	20	PASS
		Ant2	5300	30~1000	-83.15	-54.00	0.00484	4	PASS
				1000~26000	-67.03	-47.00	0.19815	20	PASS
		total	5300	30~1000	---	---	0.01030	4	PASS
				1000~26000	---	---	0.40708	20	PASS



		Ant1	5320	30~1000	-82.18	-54.00	0.00605	4	PASS
				1000~26000	-65.72	-47.00	0.26792	20	PASS
		Ant2	5320	30~1000	-82.10	-54.00	0.00617	4	PASS
				1000~26000	-65.37	-47.00	0.29040	20	PASS
		total	5320	30~1000	---	---	0.01222	4	PASS
				1000~26000	---	---	0.55832	20	PASS
		Ant1	5500	30~1000	-82.27	-54.00	0.00593	4	PASS
				1000~26000	-65.76	-47.00	0.26546	20	PASS
		Ant2	5500	30~1000	-81.25	-54.00	0.00750	4	PASS
				1000~26000	-65.91	-47.00	0.25645	20	PASS
		total	5500	30~1000	---	---	0.01343	4	PASS
				1000~26000	---	---	0.52191	20	PASS
		Ant1	5580	30~1000	-82.74	-54.00	0.00532	4	PASS
				1000~26000	-66.67	-47.00	0.21528	20	PASS
		Ant2	5580	30~1000	-82.99	-54.00	0.00502	4	PASS
				1000~26000	-65.94	-47.00	0.25468	20	PASS
		total	5580	30~1000	---	---	0.01034	4	PASS
				1000~26000	---	---	0.46996	20	PASS
		Ant1	5600	30~1000	-82.64	-54.00	0.00545	4	PASS
				1000~26000	-66.72	-47.00	0.21281	20	PASS
		Ant2	5600	30~1000	-82.38	-54.00	0.00578	4	PASS
				1000~26000	-66.61	-47.00	0.21827	20	PASS
		total	5600	30~1000	---	---	0.01123	4	PASS
				1000~26000	---	---	0.43108	20	PASS
		Ant1	5700	30~1000	-81.95	-54.00	0.00638	4	PASS
				1000~26000	-66.33	-47.00	0.23281	20	PASS
		Ant2	5700	30~1000	-82.49	-54.00	0.00564	4	PASS
				1000~26000	-66.08	-47.00	0.24660	20	PASS
		total	5700	30~1000	---	---	0.01202	4	PASS
				1000~26000	---	---	0.47941	20	PASS
	11N20MIMO	Ant1	5180	30~1000	-83.36	-54.00	0.00461	4	PASS
				1000~26000	-66.71	-47.00	0.21330	20	PASS
		Ant2	5180	30~1000	-82.90	-54.00	0.00513	4	PASS
				1000~26000	-66.47	-47.00	0.22542	20	PASS
		total	5180	30~1000	---	---	0.00974	4	PASS
				1000~26000	---	---	0.43872	20	PASS
		Ant1	5200	30~1000	-82.40	-54.00	0.00575	4	PASS
				1000~26000	-66.68	-47.00	0.21478	20	PASS
		Ant2	5200	30~1000	-82.39	-54.00	0.00577	4	PASS
				1000~26000	-66.69	-47.00	0.21429	20	PASS
		total	5200	30~1000	---	---	0.01152	4	PASS
				1000~26000	---	---	0.42907	20	PASS
		Ant1	5220	30~1000	-82.35	-54.00	0.00582	4	PASS
				1000~26000	-64.80	-47.00	0.33113	20	PASS
		Ant2	5220	30~1000	-81.93	-54.00	0.00641	4	PASS
				1000~26000	-65.00	-47.00	0.31623	20	PASS
		total	5220	30~1000	---	---	0.01223	4	PASS
				1000~26000	---	---	0.64736	20	PASS



		Ant1	5240	30~1000	-82.26	-54.00	0.00594	4	PASS
				1000~26000	-66.01	-47.00	0.25061	20	PASS
		Ant2	5240	30~1000	-82.68	-54.00	0.00540	4	PASS
				1000~26000	-66.47	-47.00	0.22542	20	PASS
		total	5240	30~1000	---	---	0.01134	4	PASS
				1000~26000	---	---	0.47603	20	PASS
		Ant1	5260	30~1000	-83.13	-54.00	0.00486	4	PASS
				1000~26000	-66.53	-47.00	0.22233	20	PASS
		Ant2	5260	30~1000	-82.86	-54.00	0.00518	4	PASS
				1000~26000	-66.14	-47.00	0.24322	20	PASS
		total	5260	30~1000	---	---	0.01004	4	PASS
				1000~26000	---	---	0.46555	20	PASS
		Ant1	5280	30~1000	-82.93	-54.00	0.00509	4	PASS
				1000~26000	-67.05	-47.00	0.19724	20	PASS
		Ant2	5280	30~1000	-82.72	-54.00	0.00535	4	PASS
				1000~26000	-66.90	-47.00	0.20417	20	PASS
		total	5280	30~1000	---	---	0.01044	4	PASS
				1000~26000	---	---	0.40141	20	PASS
		Ant1	5300	30~1000	-83.41	-54.00	0.00456	4	PASS
				1000~26000	-66.52	-47.00	0.22284	20	PASS
		Ant2	5300	30~1000	-82.62	-54.00	0.00547	4	PASS
				1000~26000	-66.64	-47.00	0.21677	20	PASS
		total	5300	30~1000	---	---	0.01003	4	PASS
				1000~26000	---	---	0.43961	20	PASS
		Ant1	5320	30~1000	-82.19	-54.00	0.00604	4	PASS
				1000~26000	-65.59	-47.00	0.27606	20	PASS
		Ant2	5320	30~1000	-81.90	-54.00	0.00646	4	PASS
				1000~26000	-65.28	-47.00	0.29648	20	PASS
		total	5320	30~1000	---	---	0.01250	4	PASS
				1000~26000	---	---	0.57254	20	PASS
		Ant1	5500	30~1000	-82.77	-54.00	0.00528	4	PASS
				1000~26000	-66.58	-47.00	0.21979	20	PASS
		Ant2	5500	30~1000	-82.51	-54.00	0.00561	4	PASS
				1000~26000	-66.73	-47.00	0.21232	20	PASS
		total	5500	30~1000	---	---	0.01089	4	PASS
				1000~26000	---	---	0.43211	20	PASS
		Ant1	5580	30~1000	-82.84	-54.00	0.00520	4	PASS
				1000~26000	-66.80	-47.00	0.20893	20	PASS
		Ant2	5580	30~1000	-82.08	-54.00	0.00619	4	PASS
				1000~26000	-66.58	-47.00	0.21979	20	PASS
		total	5580	30~1000	---	---	0.01139	4	PASS
				1000~26000	---	---	0.42872	20	PASS
		Ant1	5600	30~1000	-82.20	-54.00	0.00603	4	PASS
				1000~26000	-66.70	-47.00	0.21380	20	PASS
		Ant2	5600	30~1000	-82.72	-54.00	0.00535	4	PASS
				1000~26000	-66.03	-47.00	0.24946	20	PASS
		total	5600	30~1000	---	---	0.01138	4	PASS
				1000~26000	---	---	0.46326	20	PASS



11N40MIMO		Ant1	5700	30~1000	-80.55	-54.00	0.00881	4	PASS
				1000~26000	-65.17	-47.00	0.30409	20	PASS
		Ant2	5700	30~1000	-82.09	-54.00	0.00618	4	PASS
				1000~26000	-65.34	-47.00	0.29242	20	PASS
		total	5700	30~1000	---	---	0.01499	4	PASS
				1000~26000	---	---	0.59651	20	PASS
		Ant1	5190	30~1000	-82.03	-54.00	0.00627	4	PASS
				1000~26000	-65.86	-47.00	0.25942	20	PASS
		Ant2	5190	30~1000	-82.22	-54.00	0.00600	4	PASS
				1000~26000	-65.59	-47.00	0.27606	20	PASS
		total	5190	30~1000	---	---	0.01227	4	PASS
				1000~26000	---	---	0.53548	20	PASS
		Ant1	5230	30~1000	-83.03	-54.00	0.00498	4	PASS
				1000~26000	-66.28	-47.00	0.23550	20	PASS
		Ant2	5230	30~1000	-82.07	-54.00	0.00621	4	PASS
				1000~26000	-66.18	-47.00	0.24099	20	PASS
		total	5230	30~1000	---	---	0.01119	4	PASS
				1000~26000	---	---	0.47649	20	PASS
		Ant1	5270	30~1000	-82.81	-54.00	0.00524	4	PASS
				1000~26000	-66.99	-47.00	0.19999	20	PASS
		Ant2	5270	30~1000	-82.88	-54.00	0.00515	4	PASS
				1000~26000	-67.23	-47.00	0.18923	20	PASS
		total	5270	30~1000	---	---	0.01039	4	PASS
				1000~26000	---	---	0.38922	20	PASS
		Ant1	5310	30~1000	-82.01	-54.00	0.00630	4	PASS
				1000~26000	-65.14	-47.00	0.30620	20	PASS
		Ant2	5310	30~1000	-82.32	-54.00	0.00586	4	PASS
				1000~26000	-65.97	-47.00	0.25293	20	PASS
		total	5310	30~1000	---	---	0.01216	4	PASS
				1000~26000	---	---	0.55913	20	PASS
		Ant1	5510	30~1000	-83.03	-54.00	0.00498	4	PASS
				1000~26000	-66.53	-47.00	0.22233	20	PASS
		Ant2	5510	30~1000	-82.13	-54.00	0.00612	4	PASS
				1000~26000	-66.94	-47.00	0.20230	20	PASS
		total	5510	30~1000	---	---	0.01110	4	PASS
				1000~26000	---	---	0.42463	20	PASS
		Ant1	5590	30~1000	-82.43	-54.00	0.00571	4	PASS
				1000~26000	-66.59	-47.00	0.21928	20	PASS
		Ant2	5590	30~1000	-82.49	-54.00	0.00564	4	PASS
				1000~26000	-65.91	-47.00	0.25645	20	PASS
		total	5590	30~1000	---	---	0.01135	4	PASS
				1000~26000	---	---	0.47573	20	PASS
		Ant1	5670	30~1000	-81.70	-54.00	0.00676	4	PASS
				1000~26000	-65.61	-47.00	0.27479	20	PASS
		Ant2	5670	30~1000	-81.95	-54.00	0.00638	4	PASS
				1000~26000	-65.45	-47.00	0.28510	20	PASS
		total	5670	30~1000	---	---	0.01314	4	PASS
				1000~26000	---	---	0.55989	20	PASS



	11AC80MIMO	Ant1	5210	30~1000	-82.28	-54.00	0.00592	4	PASS
				1000~26000	-66.00	-47.00	0.25119	20	PASS
		Ant2	5210	30~1000	-82.12	-54.00	0.00614	4	PASS
				1000~26000	-65.76	-47.00	0.26546	20	PASS
		total	5210	30~1000	---	---	0.01206	4	PASS
				1000~26000	---	---	0.51665	20	PASS
		Ant1	5290	30~1000	-81.79	-54.00	0.00662	4	PASS
				1000~26000	-66.20	-47.00	0.23988	20	PASS
		Ant2	5290	30~1000	-80.72	-54.00	0.00847	4	PASS
				1000~26000	-65.88	-47.00	0.25823	20	PASS
		total	5290	30~1000	---	---	0.01509	4	PASS
				1000~26000	---	---	0.49811	20	PASS
		Ant1	5530	30~1000	-82.37	-54.00	0.00579	4	PASS
				1000~26000	-66.90	-47.00	0.20417	20	PASS
		Ant2	5530	30~1000	-82.58	-54.00	0.00552	4	PASS
				1000~26000	-65.92	-47.00	0.25586	20	PASS
		total	5530	30~1000	---	---	0.01131	4	PASS
				1000~26000	---	---	0.46003	20	PASS
		Ant1	5610	30~1000	-81.39	-54.00	0.00726	4	PASS
				1000~26000	-65.24	-47.00	0.29923	20	PASS
		Ant2	5610	30~1000	-82.01	-54.00	0.00630	4	PASS
				1000~26000	-65.49	-47.00	0.28249	20	PASS
		total	5610	30~1000	---	---	0.01356	4	PASS
				1000~26000	---	---	0.58172	20	PASS
	11AX20MIMO	Ant1	5180	30~1000	-81.18	-54.00	0.00762	4	PASS
				1000~26000	-65.36	-47.00	0.29107	20	PASS
		Ant2	5180	30~1000	-81.75	-54.00	0.00668	4	PASS
				1000~26000	-65.05	-47.00	0.31261	20	PASS
		total	5180	30~1000	---	---	0.01430	4	PASS
				1000~26000	---	---	0.60368	20	PASS
		Ant1	5200	30~1000	-82.53	-54.00	0.00558	4	PASS
				1000~26000	-66.54	-47.00	0.22182	20	PASS
		Ant2	5200	30~1000	-83.21	-54.00	0.00478	4	PASS
				1000~26000	-66.83	-47.00	0.20749	20	PASS
		total	5200	30~1000	---	---	0.01036	4	PASS
				1000~26000	---	---	0.42931	20	PASS
		Ant1	5220	30~1000	-82.70	-54.00	0.00537	4	PASS
				1000~26000	-66.94	-47.00	0.20230	20	PASS
		Ant2	5220	30~1000	-83.28	-54.00	0.00470	4	PASS
				1000~26000	-67.04	-47.00	0.19770	20	PASS
		total	5220	30~1000	---	---	0.01007	4	PASS
				1000~26000	---	---	0.40000	20	PASS
		Ant1	5240	30~1000	-82.71	-54.00	0.00536	4	PASS
				1000~26000	-66.87	-47.00	0.20559	20	PASS
		Ant2	5240	30~1000	-82.83	-54.00	0.00521	4	PASS
				1000~26000	-66.53	-47.00	0.22233	20	PASS
		total	5240	30~1000	---	---	0.01057	4	PASS
				1000~26000	---	---	0.42792	20	PASS



		Ant1	5260	30~1000	-82.62	-54.00	0.00547	4	PASS
				1000~26000	-66.84	-47.00	0.20701	20	PASS
		Ant2	5260	30~1000	-82.68	-54.00	0.00540	4	PASS
				1000~26000	-66.37	-47.00	0.23067	20	PASS
		total	5260	30~1000	---	---	0.01087	4	PASS
				1000~26000	---	---	0.43768	20	PASS
		Ant1	5280	30~1000	-82.94	-54.00	0.00508	4	PASS
				1000~26000	-66.67	-47.00	0.21528	20	PASS
		Ant2	5280	30~1000	-82.70	-54.00	0.00537	4	PASS
				1000~26000	-65.98	-47.00	0.25235	20	PASS
		total	5280	30~1000	---	---	0.01045	4	PASS
				1000~26000	---	---	0.46763	20	PASS
		Ant1	5300	30~1000	-82.58	-54.00	0.00552	4	PASS
				1000~26000	-66.76	-47.00	0.21086	20	PASS
		Ant2	5300	30~1000	-82.26	-54.00	0.00594	4	PASS
				1000~26000	-66.43	-47.00	0.22751	20	PASS
		total	5300	30~1000	---	---	0.01146	4	PASS
				1000~26000	---	---	0.43837	20	PASS
		Ant1	5320	30~1000	-81.77	-54.00	0.00665	4	PASS
				1000~26000	-65.43	-47.00	0.28642	20	PASS
		Ant2	5320	30~1000	-82.02	-54.00	0.00628	4	PASS
				1000~26000	-65.24	-47.00	0.29923	20	PASS
		total	5320	30~1000	---	---	0.01293	4	PASS
				1000~26000	---	---	0.58565	20	PASS
		Ant1	5500	30~1000	-83.01	-54.00	0.00500	4	PASS
				1000~26000	-66.59	-47.00	0.21928	20	PASS
		Ant2	5500	30~1000	-82.52	-54.00	0.00560	4	PASS
				1000~26000	-66.21	-47.00	0.23933	20	PASS
		total	5500	30~1000	---	---	0.01060	4	PASS
				1000~26000	---	---	0.45861	20	PASS
		Ant1	5580	30~1000	-82.88	-54.00	0.00515	4	PASS
				1000~26000	-66.49	-47.00	0.22439	20	PASS
		Ant2	5580	30~1000	-82.87	-54.00	0.00516	4	PASS
				1000~26000	-65.72	-47.00	0.26792	20	PASS
		total	5580	30~1000	---	---	0.01031	4	PASS
				1000~26000	---	---	0.49231	20	PASS
		Ant1	5600	30~1000	-82.49	-54.00	0.00564	4	PASS
				1000~26000	-66.76	-47.00	0.21086	20	PASS
		Ant2	5600	30~1000	-82.60	-54.00	0.00550	4	PASS
				1000~26000	-66.53	-47.00	0.22233	20	PASS
		total	5600	30~1000	---	---	0.01114	4	PASS
				1000~26000	---	---	0.43319	20	PASS
		Ant1	5700	30~1000	-81.56	-54.00	0.00698	4	PASS
				1000~26000	-65.48	-47.00	0.28314	20	PASS
		Ant2	5700	30~1000	-82.05	-54.00	0.00624	4	PASS
				1000~26000	-65.60	-47.00	0.27542	20	PASS
		total	5700	30~1000	---	---	0.01322	4	PASS
				1000~26000	---	---	0.55856	20	PASS



	11AX40MIMO	Ant1	5190	30~1000	-82.47	-54.00	0.00566	4	PASS
				1000~26000	-65.98	-47.00	0.25235	20	PASS
		Ant2	5190	30~1000	-81.44	-54.00	0.00718	4	PASS
				1000~26000	-65.14	-47.00	0.30620	20	PASS
		total	5190	30~1000	---	---	0.01284	4	PASS
				1000~26000	---	---	0.55855	20	PASS
		Ant1	5230	30~1000	-82.43	-54.00	0.00571	4	PASS
				1000~26000	-66.66	-47.00	0.21577	20	PASS
		Ant2	5230	30~1000	-82.88	-54.00	0.00515	4	PASS
				1000~26000	-66.40	-47.00	0.22909	20	PASS
		total	5230	30~1000	---	---	0.01086	4	PASS
				1000~26000	---	---	0.44486	20	PASS
		Ant1	5270	30~1000	-82.91	-54.00	0.00512	4	PASS
				1000~26000	-66.39	-47.00	0.22961	20	PASS
		Ant2	5270	30~1000	-82.96	-54.00	0.00506	4	PASS
				1000~26000	-66.57	-47.00	0.22029	20	PASS
		total	5270	30~1000	---	---	0.01018	4	PASS
				1000~26000	---	---	0.44990	20	PASS
		Ant1	5310	30~1000	-82.38	-54.00	0.00578	4	PASS
				1000~26000	-65.48	-47.00	0.28314	20	PASS
		Ant2	5310	30~1000	-81.41	-54.00	0.00723	4	PASS
				1000~26000	-65.37	-47.00	0.29040	20	PASS
		total	5310	30~1000	---	---	0.01301	4	PASS
				1000~26000	---	---	0.57354	20	PASS
		Ant1	5510	30~1000	-83.19	-54.00	0.00480	4	PASS
				1000~26000	-66.61	-47.00	0.21827	20	PASS
		Ant2	5510	30~1000	-82.56	-54.00	0.00555	4	PASS
				1000~26000	-66.32	-47.00	0.23335	20	PASS
		total	5510	30~1000	---	---	0.01035	4	PASS
				1000~26000	---	---	0.45162	20	PASS
		Ant1	5590	30~1000	-82.27	-54.00	0.00593	4	PASS
				1000~26000	-66.68	-47.00	0.21478	20	PASS
		Ant2	5590	30~1000	-82.34	-54.00	0.00583	4	PASS
				1000~26000	-66.41	-47.00	0.22856	20	PASS
		total	5590	30~1000	---	---	0.01176	4	PASS
				1000~26000	---	---	0.44334	20	PASS
		Ant1	5670	30~1000	-81.04	-54.00	0.00787	4	PASS
				1000~26000	-65.59	-47.00	0.27606	20	PASS
		Ant2	5670	30~1000	-81.49	-54.00	0.00710	4	PASS
				1000~26000	-65.47	-47.00	0.28379	20	PASS
		total	5670	30~1000	---	---	0.01497	4	PASS
				1000~26000	---	---	0.55985	20	PASS
	11AX80MIMO	Ant1	5210	30~1000	-81.84	-54.00	0.00655	4	PASS
				1000~26000	-65.95	-47.00	0.25410	20	PASS
		Ant2	5210	30~1000	-82.05	-54.00	0.00624	4	PASS
				1000~26000	-66.00	-47.00	0.25119	20	PASS
		total	5210	30~1000	---	---	0.01279	4	PASS
				1000~26000	---	---	0.50529	20	PASS



		Ant1	5290	30~1000	-82.47	-54.00	0.00566	4	PASS
				1000~26000	-66.03	-47.00	0.24946	20	PASS
		Ant2	5290	30~1000	-81.65	-54.00	0.00684	4	PASS
				1000~26000	-65.40	-47.00	0.28840	20	PASS
		total	5290	30~1000	---	---	0.01250	4	PASS
				1000~26000	---	---	0.53786	20	PASS
		Ant1	5530	30~1000	-82.54	-54.00	0.00557	4	PASS
				1000~26000	-66.76	-47.00	0.21086	20	PASS
		Ant2	5530	30~1000	-82.26	-54.00	0.00594	4	PASS
				1000~26000	-66.40	-47.00	0.22909	20	PASS
		total	5530	30~1000	---	---	0.01151	4	PASS
				1000~26000	---	---	0.43995	20	PASS
		Ant1	5610	30~1000	-82.25	-54.00	0.00596	4	PASS
				1000~26000	-65.19	-47.00	0.30269	20	PASS
		Ant2	5610	30~1000	-81.14	-54.00	0.00769	4	PASS
				1000~26000	-65.98	-47.00	0.25235	20	PASS
		total	5610	30~1000	---	---	0.01365	4	PASS
				1000~26000	---	---	0.55504	20	PASS

Test Graphs

