

Appendix E_5.3G WIFI

Antenna Power

Condition	Mode	Frequency (MHz)	Antenna	Power (dBm/MHz)	Power (mW/MHz)	Limit (mW/MHz)	Declared Power (mW/MHz)	Tolerance (%)	Lower Limit (%)	Upper Limit (%)	Verdict
NVNT	a	5260	Ant1	0.24	1.057	10	4	-73.58	-80	20	Pass
NVNT	a	5300	Ant1	-0.43	0.906	10	4	-77.36	-80	20	Pass
NVNT	a	5320	Ant1	-0.04	0.991	10	4	-75.23	-80	20	Pass
NVNT	a	5260	Ant2	-0.61	0.869	10	4	-78.28	-80	20	Pass
NVNT	a	5300	Ant2	-0.35	0.923	10	4	-76.94	-80	20	Pass
NVNT	a	5320	Ant2	-0.26	0.942	10	4	-76.45	-80	20	Pass
NVNT	a	5260	Ant3	-0.71	0.849	10	4	-78.77	-80	20	Pass
NVNT	a	5300	Ant3	-0.58	0.875	10	4	-78.13	-80	20	Pass
NVNT	a	5320	Ant3	-0.32	0.929	10	4	-76.78	-80	20	Pass
NVNT	ac20	5260	Ant1	-6.17	0.242	10	-	-	-	-	Pass
NVNT	ac20	5260	Ant2	-3.67	0.43	10	-	-	-	-	Pass
NVNT	ac20	5260	Ant3	-5.64	0.273	10	-	-	-	-	Pass
NVNT	ac20	5260	Sum	-0.25	0.945	10	4	-76.38	-80	20	Pass
NVNT	ac20	5300	Ant1	-5.54	0.279	10	-	-	-	-	Pass
NVNT	ac20	5300	Ant2	-4.44	0.36	10	-	-	-	-	Pass
NVNT	ac20	5300	Ant3	-5	0.316	10	-	-	-	-	Pass
NVNT	ac20	5300	Sum	-0.2	0.955	10	4	-76.13	-80	20	Pass
NVNT	ac20	5320	Ant1	-5.24	0.299	10	-	-	-	-	Pass
NVNT	ac20	5320	Ant2	-4.62	0.345	10	-	-	-	-	Pass
NVNT	ac20	5320	Ant3	-5.12	0.308	10	-	-	-	-	Pass
NVNT	ac20	5320	Sum	-0.21	0.952	10	4	-76.2	-80	20	Pass
NVNT	ac40	5270	Ant1	-8.53	0.14	5	-	-	-	-	Pass
NVNT	ac40	5270	Ant2	-8.13	0.154	5	-	-	-	-	Pass
NVNT	ac40	5270	Ant3	-8.37	0.146	5	-	-	-	-	Pass
NVNT	ac40	5270	Sum	-3.57	0.44	5	2	-78	-80	20	Pass
NVNT	ac40	5310	Ant1	-8.33	0.147	5	-	-	-	-	Pass
NVNT	ac40	5310	Ant2	-7.96	0.16	5	-	-	-	-	Pass
NVNT	ac40	5310	Ant3	-8.03	0.157	5	-	-	-	-	Pass

NVNT	ac40	5310	Sum	-3.33	0.464	5	2	-76.8	-80	20	Pass
NVNT	ac80	5290	Ant1	-12.24	0.06	2.5	-	-	-	-	Pass
NVNT	ac80	5290	Ant2	-10.38	0.092	2.5	-	-	-	-	Pass
NVNT	ac80	5290	Ant3	-10.62	0.087	2.5	-	-	-	-	Pass
NVNT	ac80	5290	Sum	-6.22	0.239	2.5	1	-76.1	-80	20	Pass
NVNT	ax20	5260	Ant1	-5.57	0.277	10	-	-	-	-	Pass
NVNT	ax20	5260	Ant2	-3.95	0.403	10	-	-	-	-	Pass
NVNT	ax20	5260	Ant3	-4.63	0.344	10	-	-	-	-	Pass
NVNT	ax20	5260	Sum	0.1	1.024	10	4	-74.4	-80	20	Pass
NVNT	ax20	5300	Ant1	-6.52	0.223	10	-	-	-	-	Pass
NVNT	ax20	5300	Ant2	-4.39	0.364	10	-	-	-	-	Pass
NVNT	ax20	5300	Ant3	-4.66	0.342	10	-	-	-	-	Pass
NVNT	ax20	5300	Sum	-0.32	0.929	10	4	-76.77	-80	20	Pass
NVNT	ax20	5320	Ant1	-6.39	0.23	10	-	-	-	-	Pass
NVNT	ax20	5320	Ant2	-5.17	0.304	10	-	-	-	-	Pass
NVNT	ax20	5320	Ant3	-4.74	0.336	10	-	-	-	-	Pass
NVNT	ax20	5320	Sum	-0.6	0.87	10	4	-78.25	-80	20	Pass
NVNT	ax40	5270	Ant1	-8.24	0.15	5	-	-	-	-	Pass
NVNT	ax40	5270	Ant2	-8.48	0.142	5	-	-	-	-	Pass
NVNT	ax40	5270	Ant3	-7.27	0.187	5	-	-	-	-	Pass
NVNT	ax40	5270	Sum	-3.2	0.479	5	2	-76.05	-80	20	Pass
NVNT	ax40	5310	Ant1	-9.57	0.11	5	-	-	-	-	Pass
NVNT	ax40	5310	Ant2	-7.38	0.183	5	-	-	-	-	Pass
NVNT	ax40	5310	Ant3	-7.21	0.19	5	-	-	-	-	Pass
NVNT	ax40	5310	Sum	-3.16	0.483	5	2	-75.85	-80	20	Pass
NVNT	ax80	5290	Ant1	-12.53	0.056	2.5	-	-	-	-	Pass
NVNT	ax80	5290	Ant2	-9.82	0.104	2.5	-	-	-	-	Pass
NVNT	ax80	5290	Ant3	-11.4	0.072	2.5	-	-	-	-	Pass
NVNT	ax80	5290	Sum	-6.35	0.232	2.5	1	-76.8	-80	20	Pass
NVNT	n20	5260	Ant1	-5.1	0.309	10	-	-	-	-	Pass
NVNT	n20	5260	Ant2	-4.49	0.356	10	-	-	-	-	Pass
NVNT	n20	5260	Ant3	-4.22	0.378	10	-	-	-	-	Pass
NVNT	n20	5260	Sum	0.18	1.043	10	4	-73.93	-80	20	Pass
NVNT	n20	5300	Ant1	-5.73	0.267	10	-	-	-	-	Pass
NVNT	n20	5300	Ant2	-4.6	0.347	10	-	-	-	-	Pass
NVNT	n20	5300	Ant3	-4.26	0.375	10	-	-	-	-	Pass
NVNT	n20	5300	Sum	-0.05	0.989	10	4	-75.28	-80	20	Pass
NVNT	n20	5320	Ant1	-6.43	0.228	10	-	-	-	-	Pass
NVNT	n20	5320	Ant2	-4.86	0.327	10	-	-	-	-	Pass
NVNT	n20	5320	Ant3	-4.69	0.34	10	-	-	-	-	Pass
NVNT	n20	5320	Sum	-0.48	0.895	10	4	-77.63	-80	20	Pass
NVNT	n40	5270	Ant1	-9.4	0.115	5	-	-	-	-	Pass




Report No.: AB26060362MW02


NVNT	n40	5270	Ant2	-7.35	0.184	5	-	-	-	-	Pass
NVNT	n40	5270	Ant3	-8.04	0.157	5	-	-	-	-	Pass
NVNT	n40	5270	Sum	-3.41	0.456	5	2	-77.2	-80	20	Pass
NVNT	n40	5310	Ant1	-8.73	0.134	5	-	-	-	-	Pass
NVNT	n40	5310	Ant2	-7.8	0.166	5	-	-	-	-	Pass
NVNT	n40	5310	Ant3	-8.17	0.152	5	-	-	-	-	Pass
NVNT	n40	5310	Sum	-3.45	0.452	5	2	-77.4	-80	20	Pass


Test Graphs



Power NVNT a 5260MHz Ant1 Pre Scan


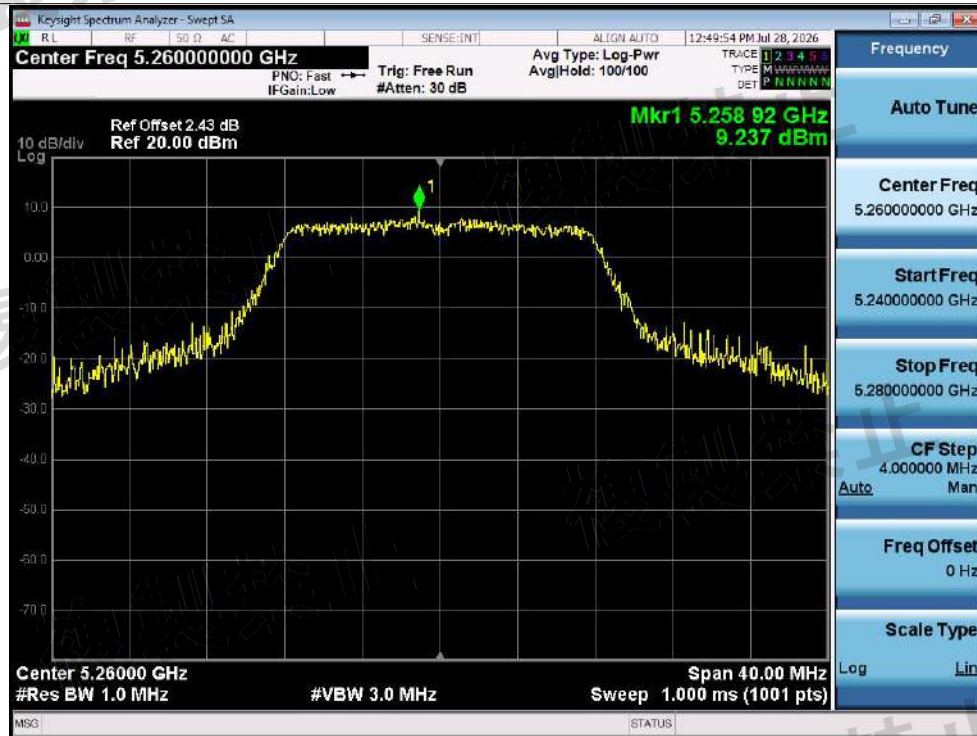




Power NVNT a 5260MHz Ant1 Zero Span

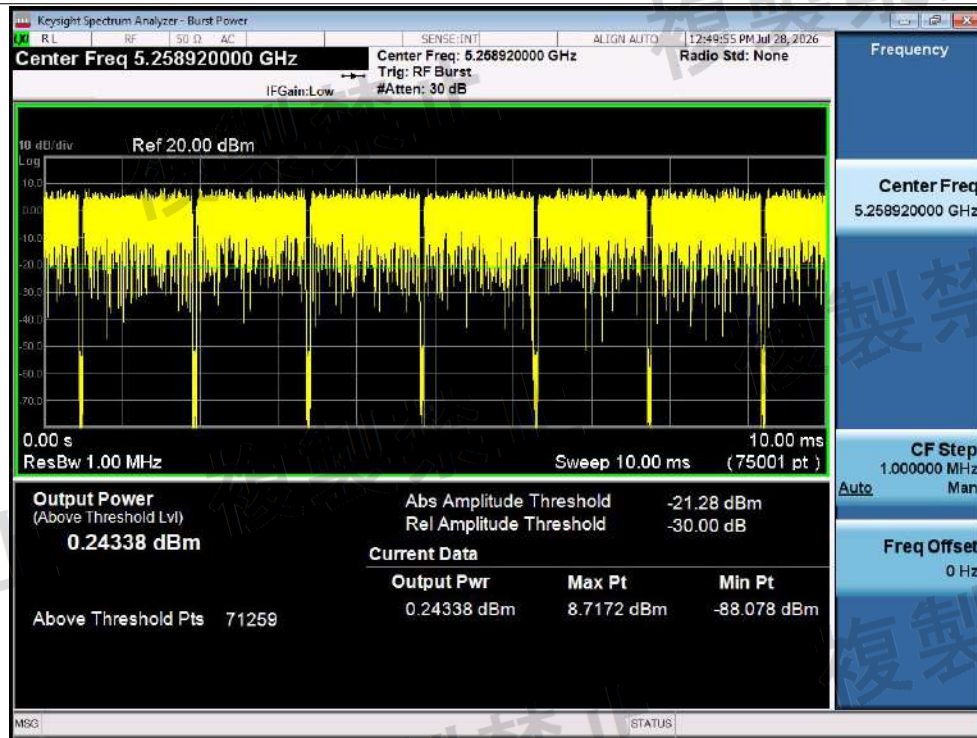



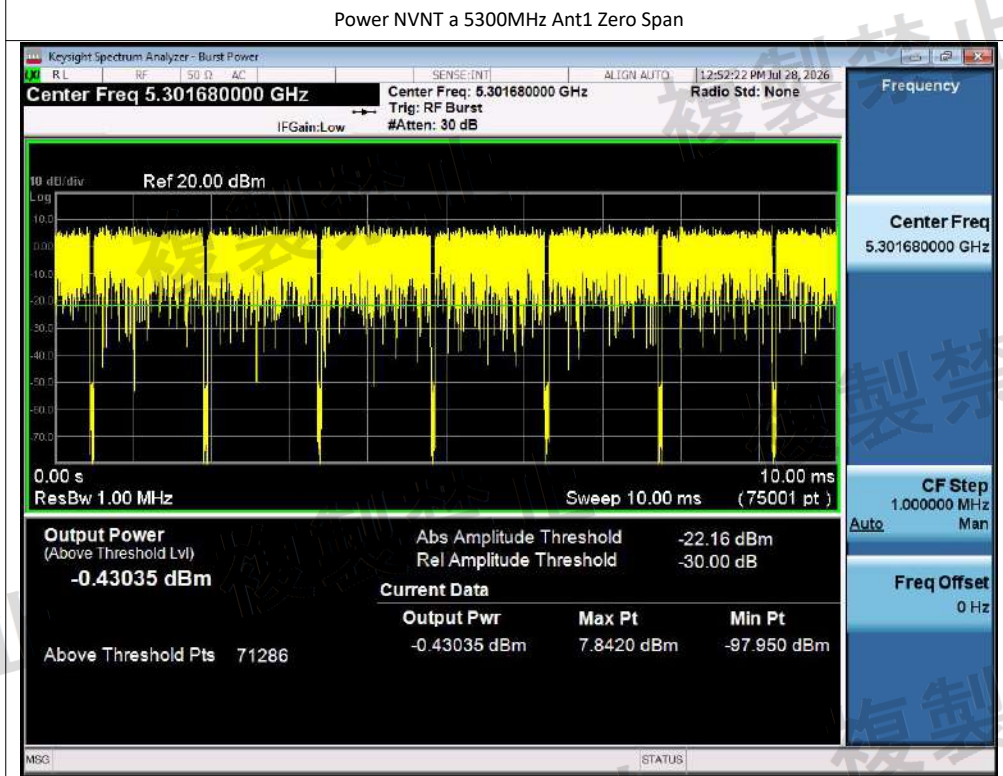


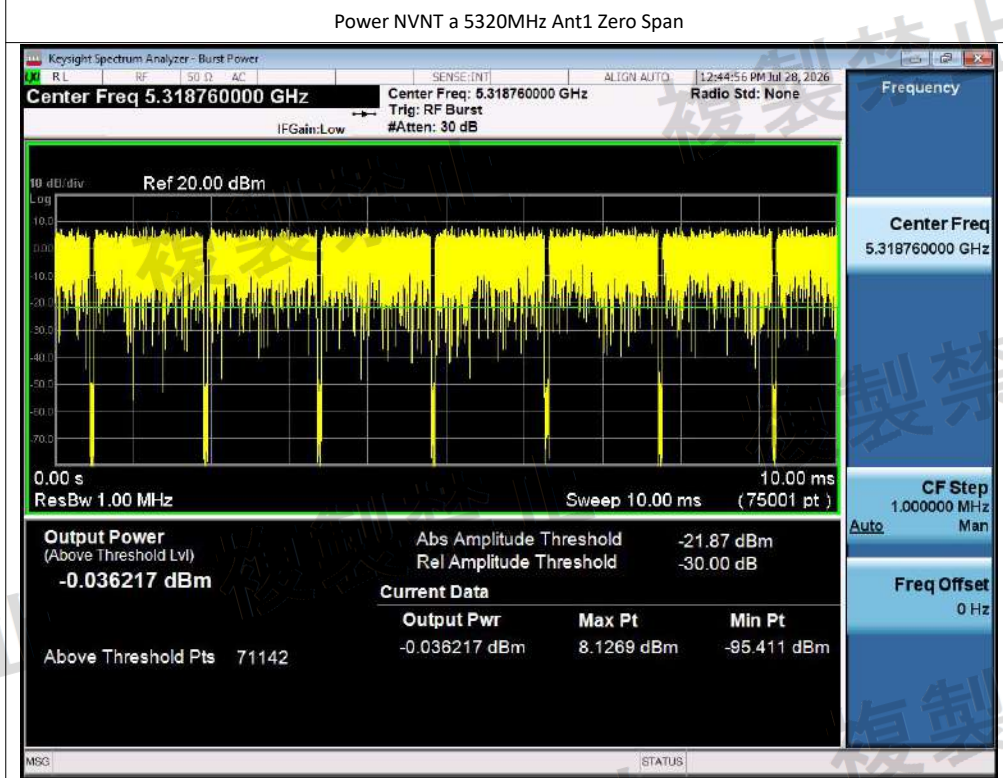
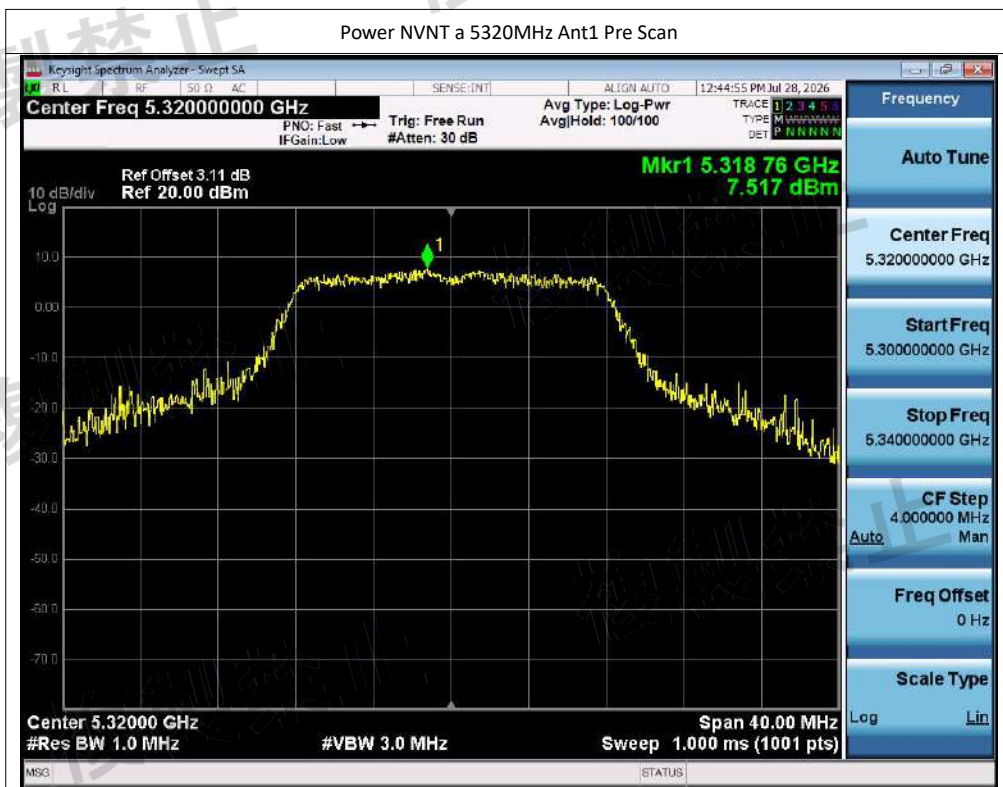


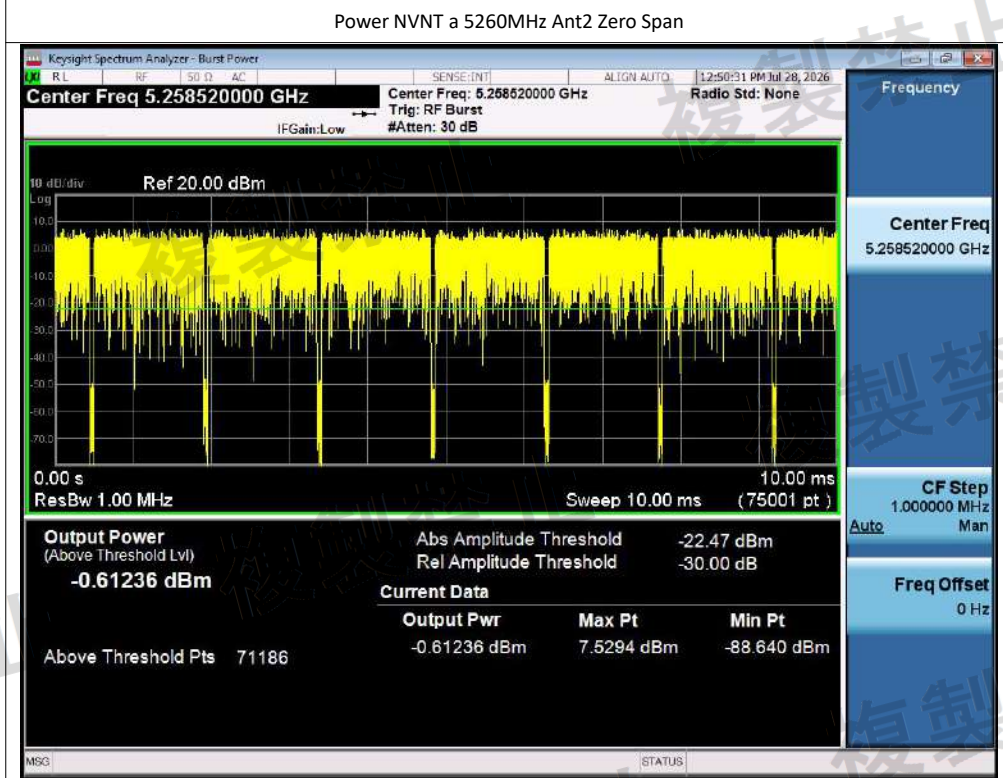
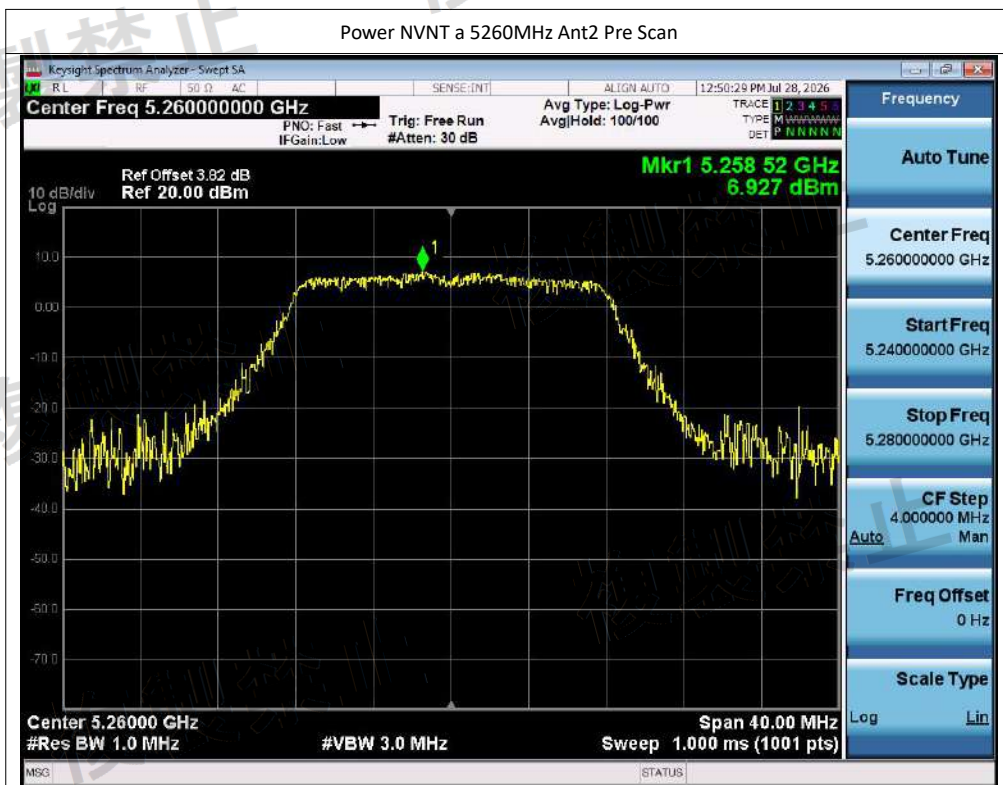


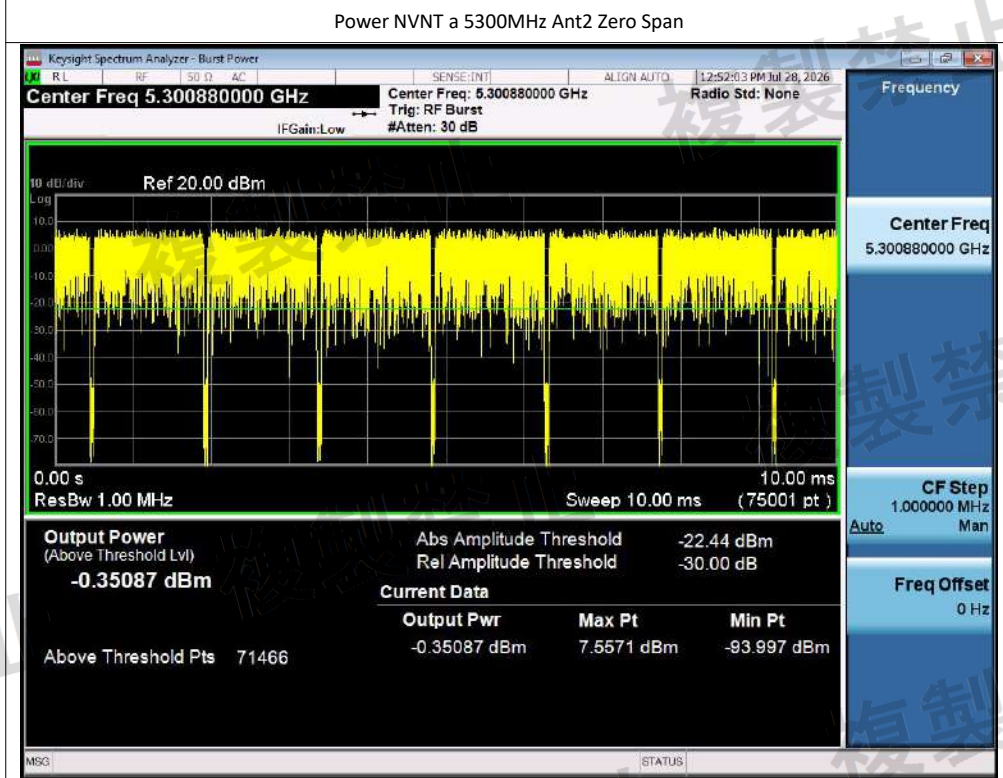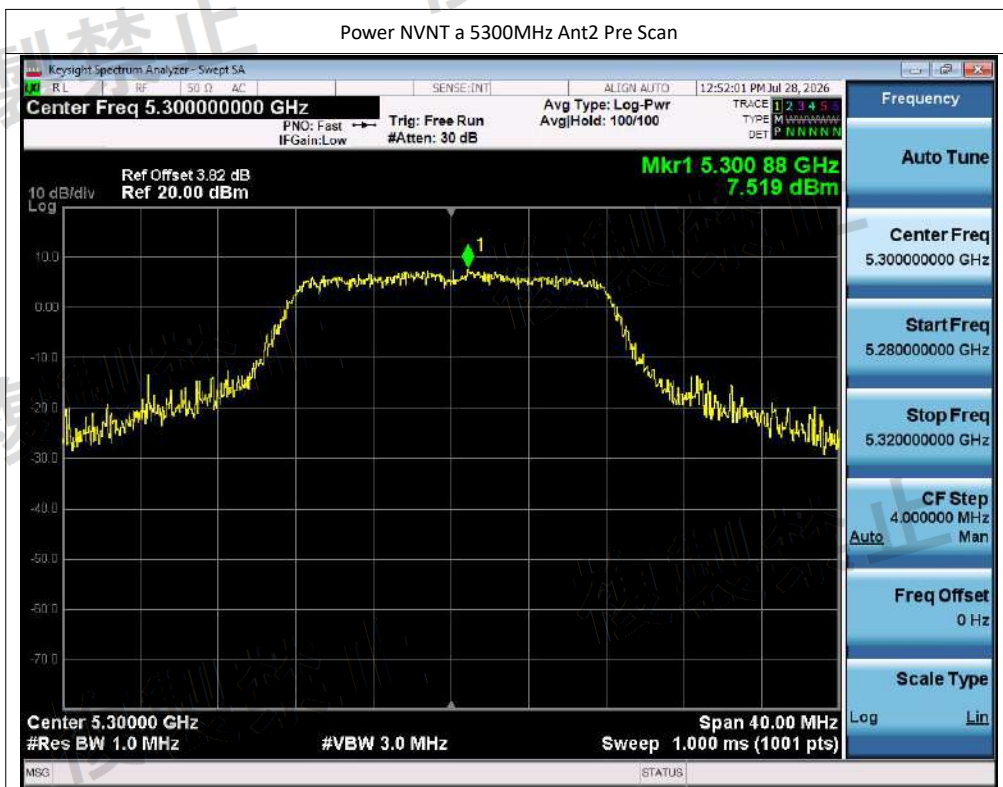

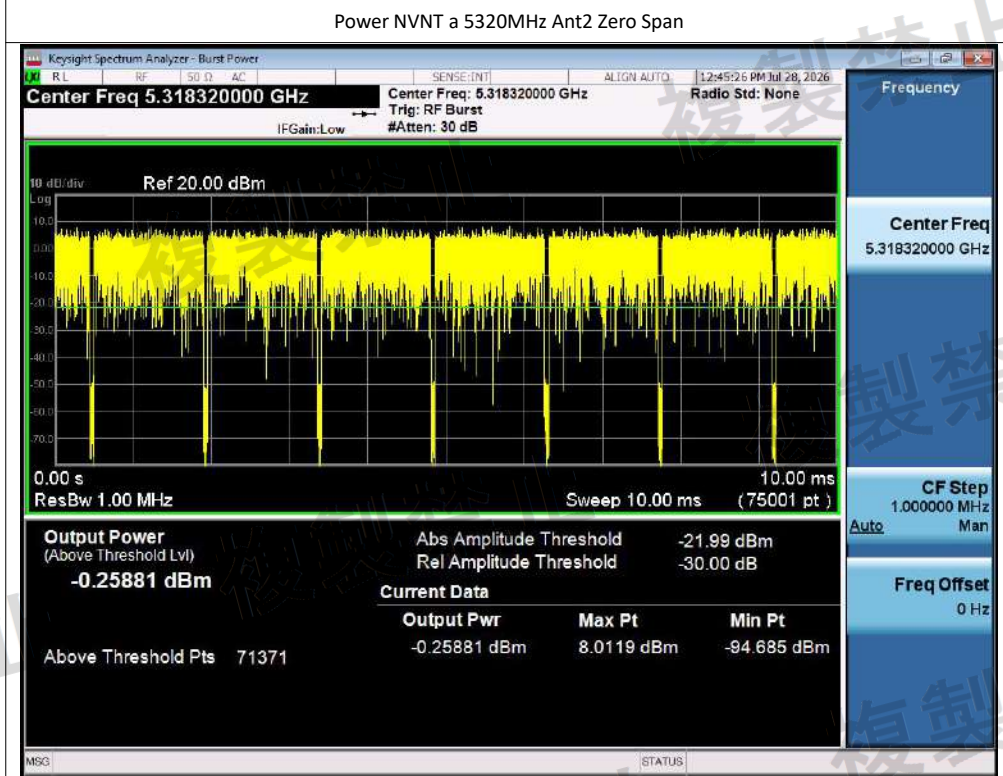

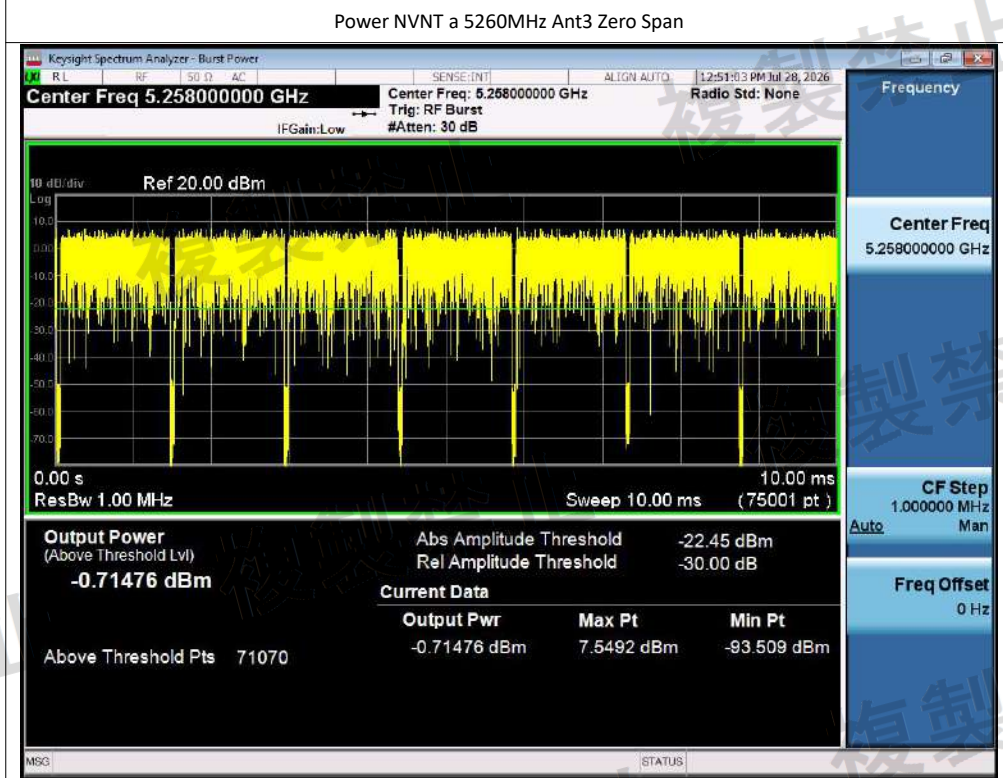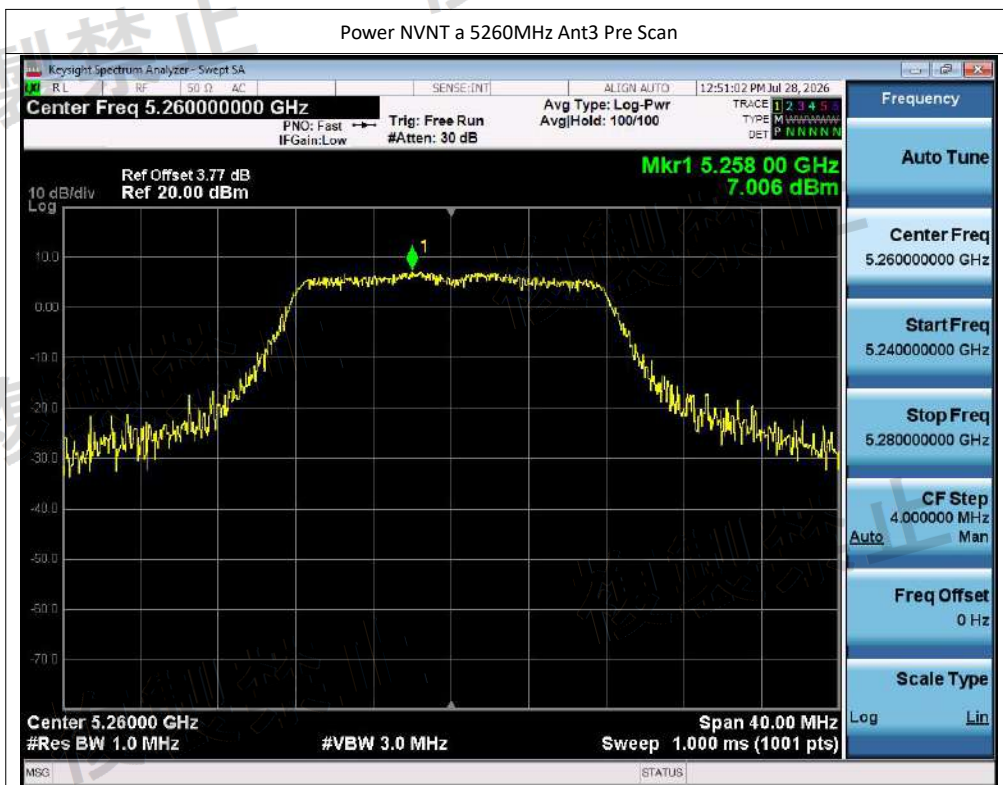

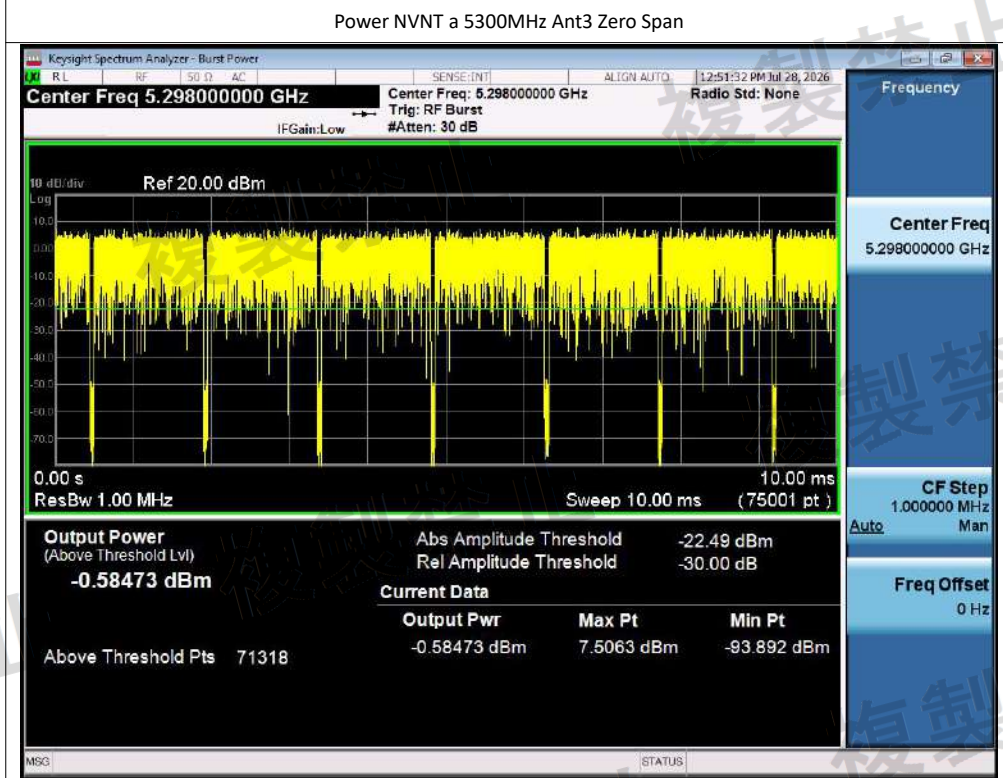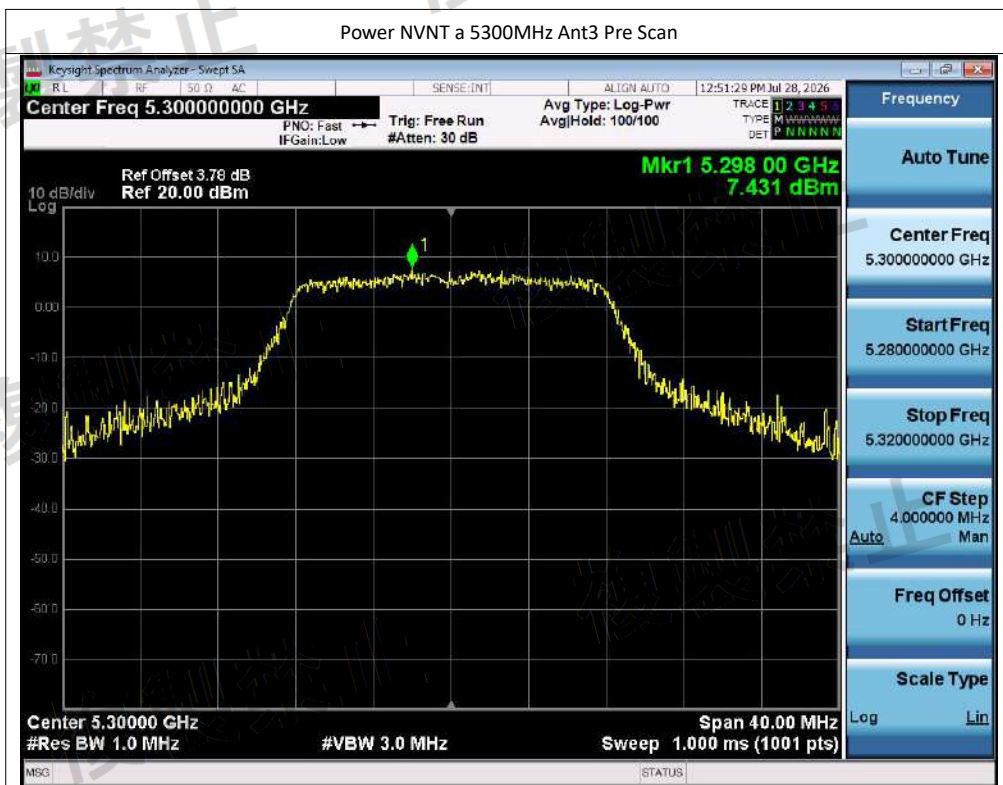

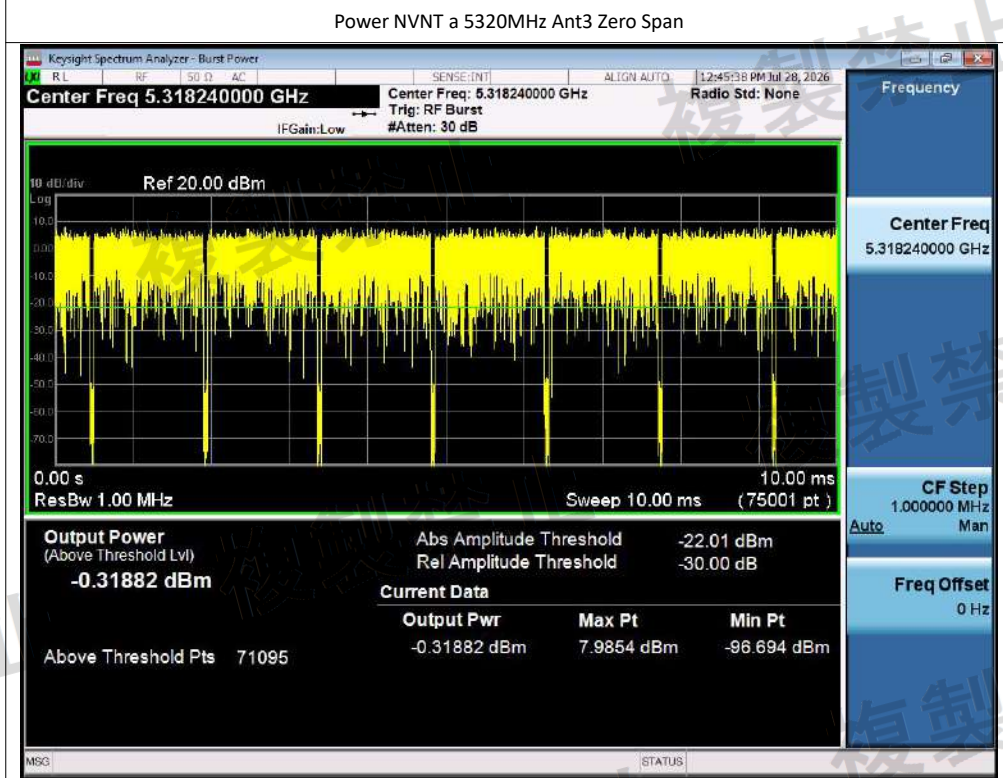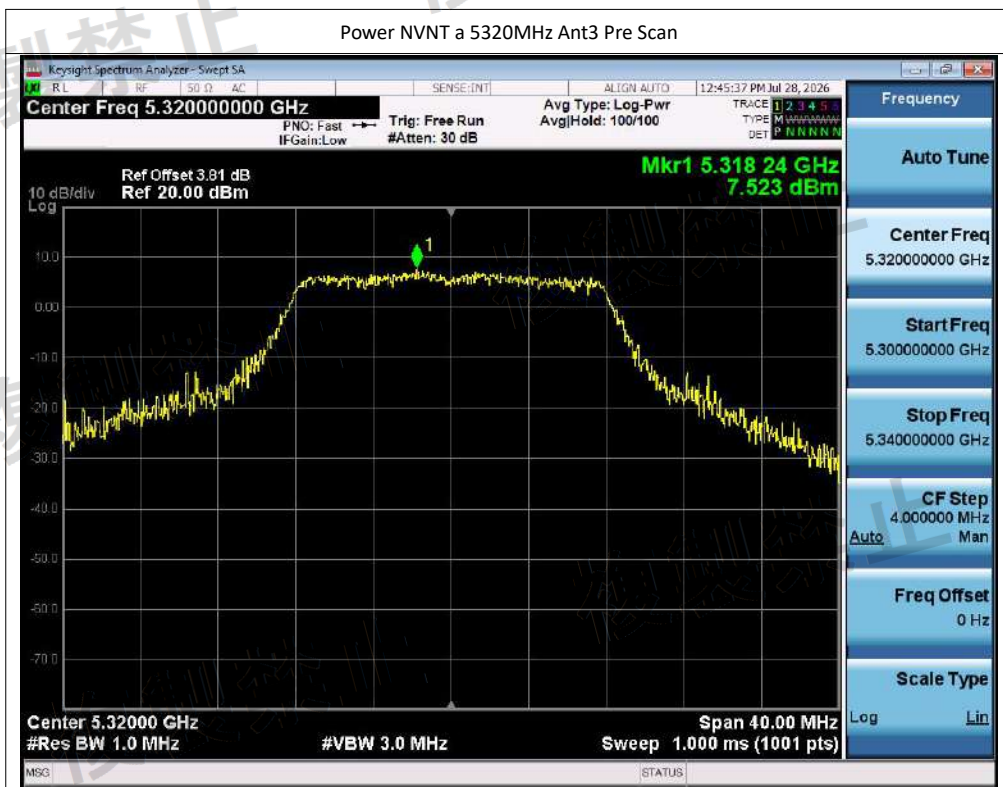



















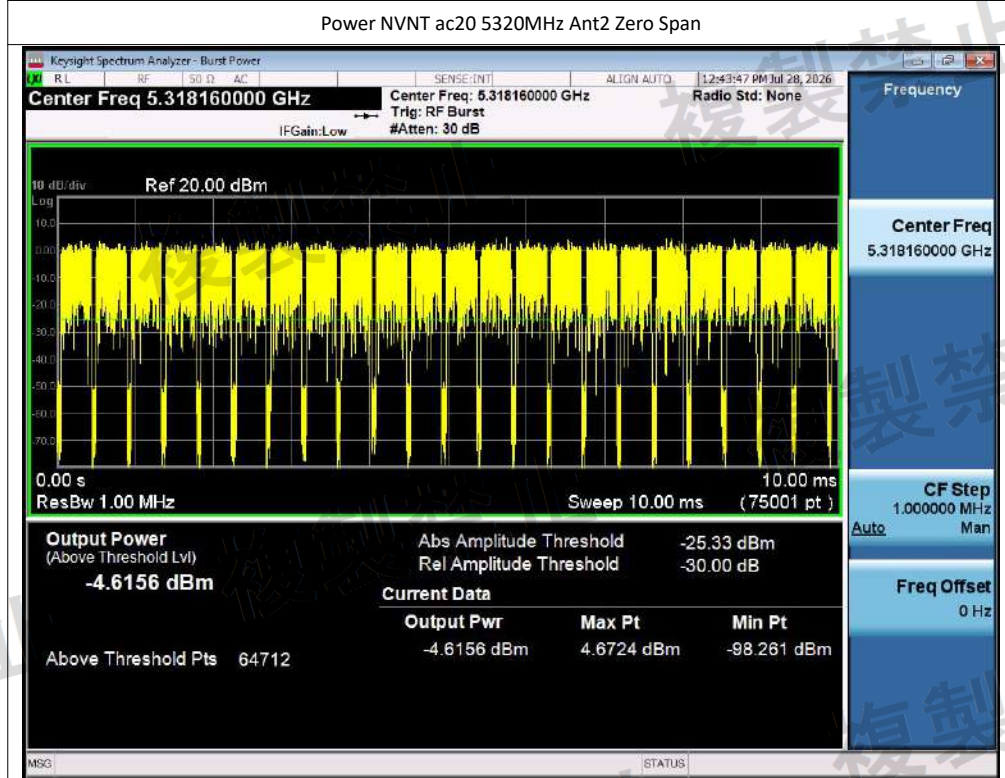



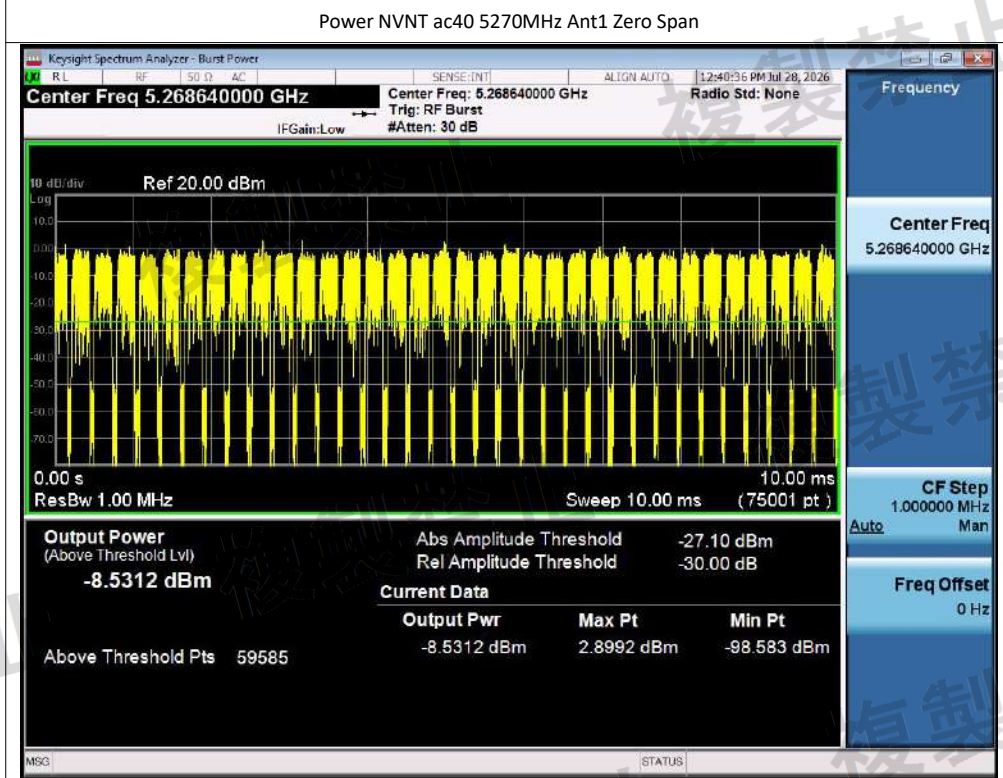

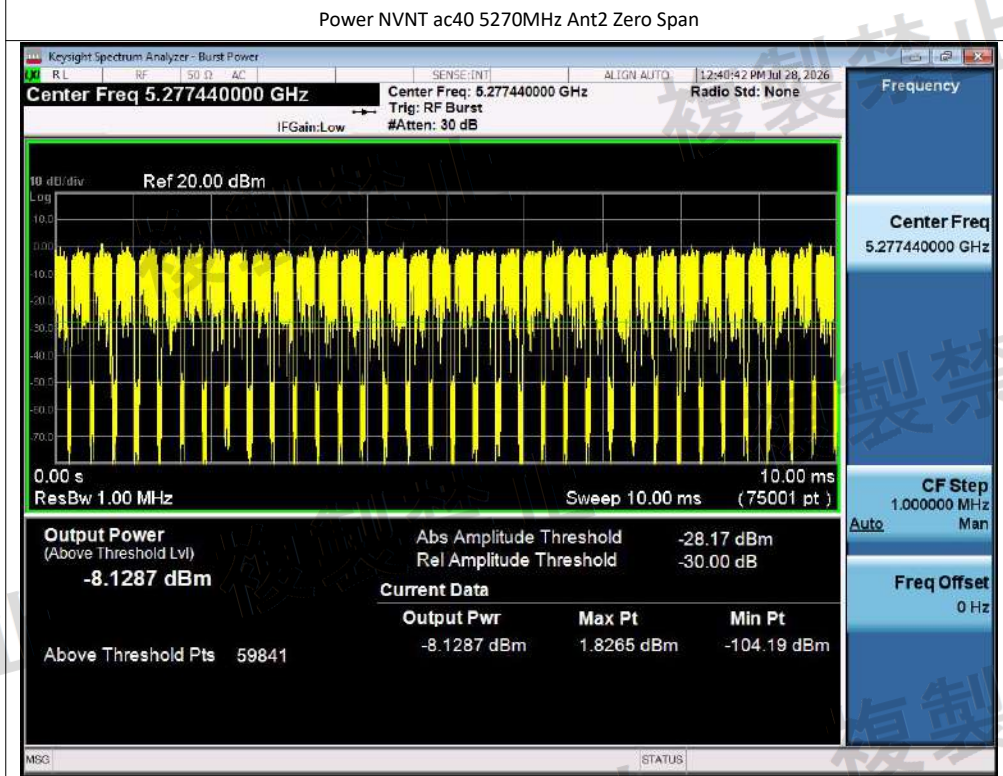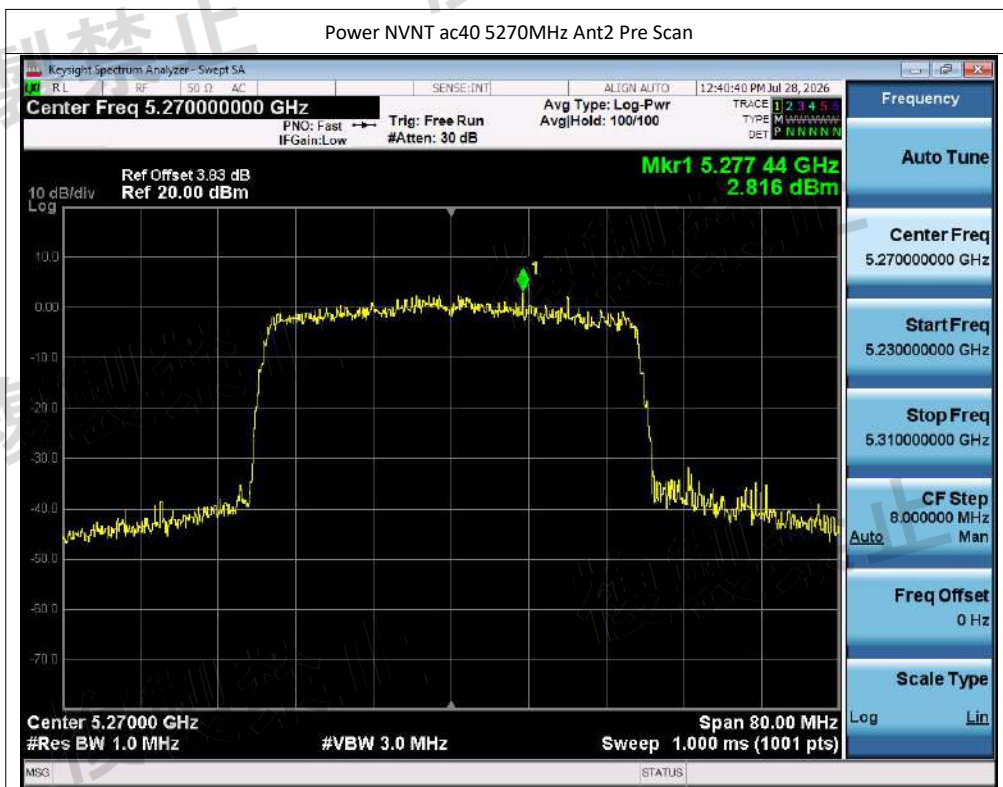













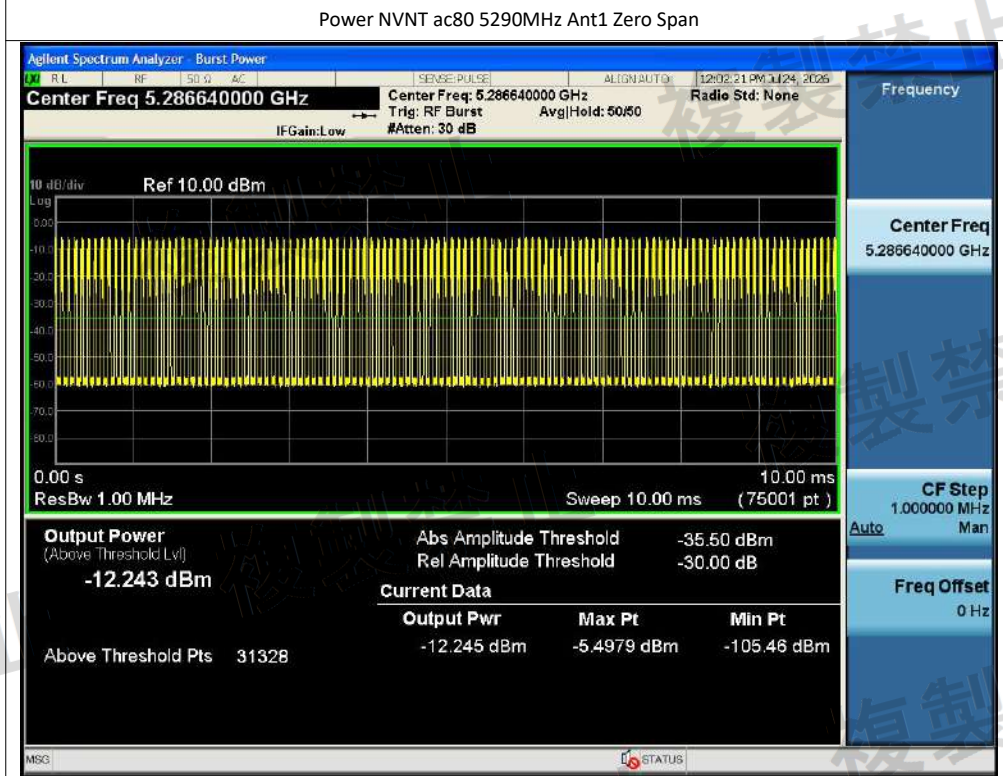


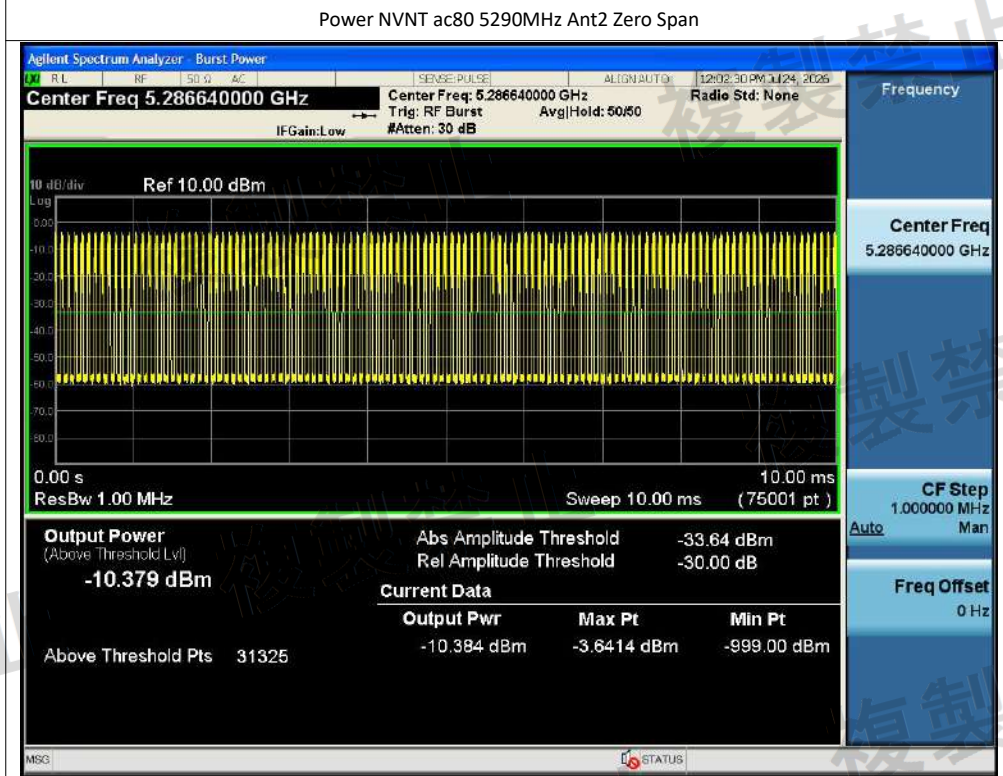

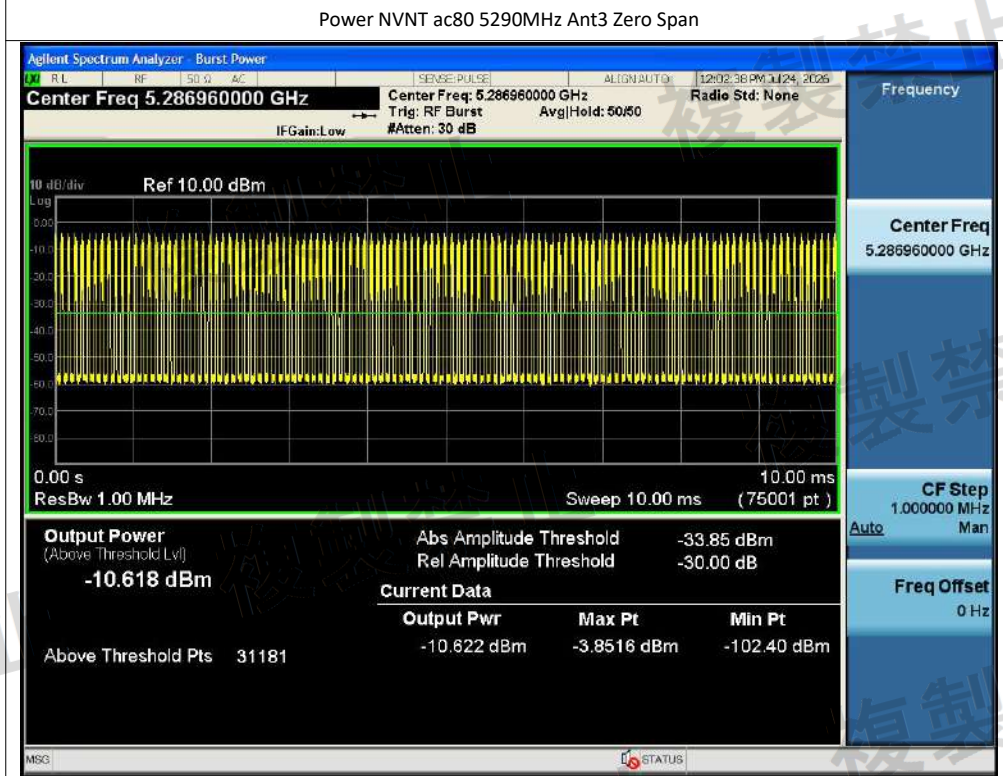


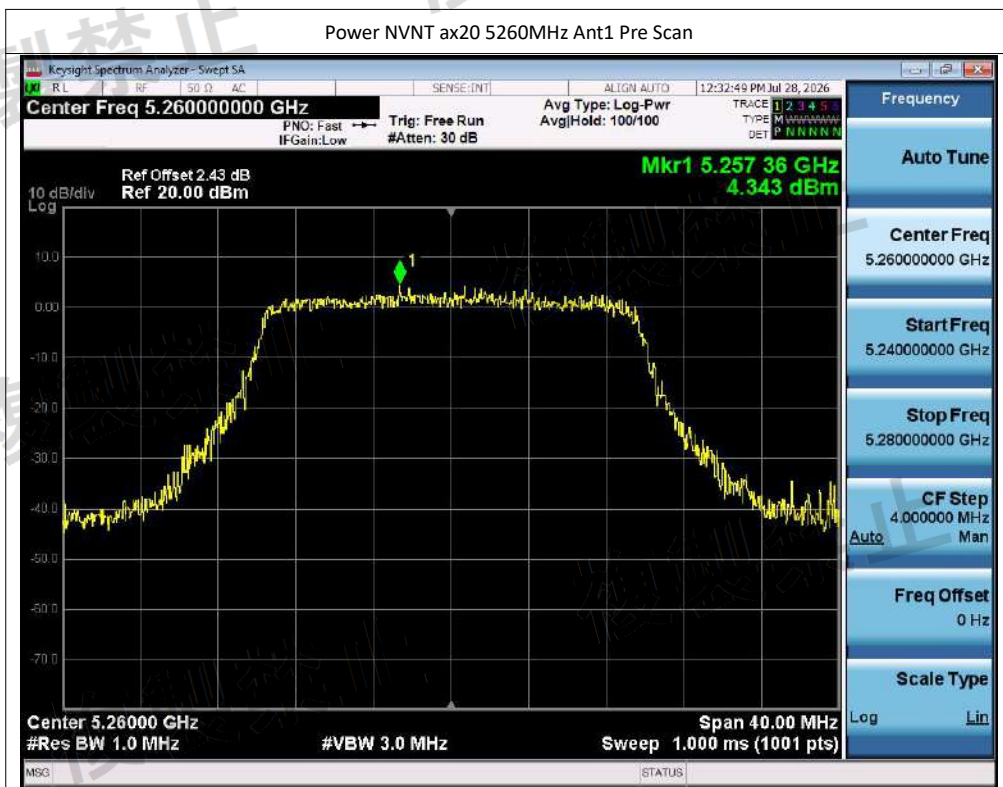




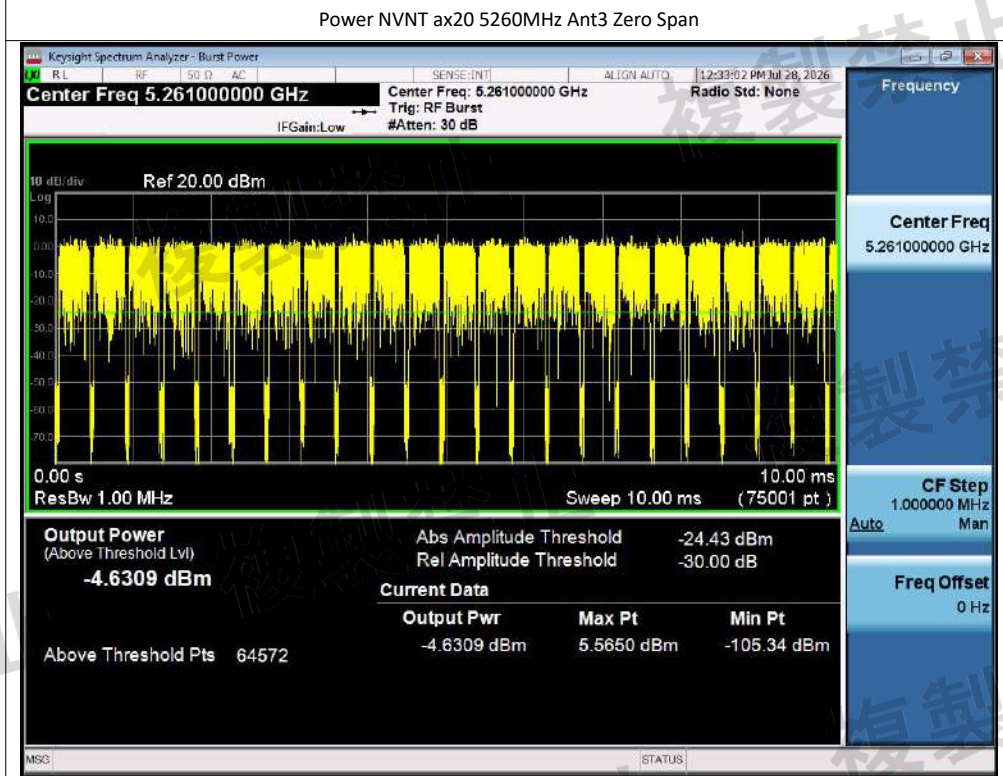



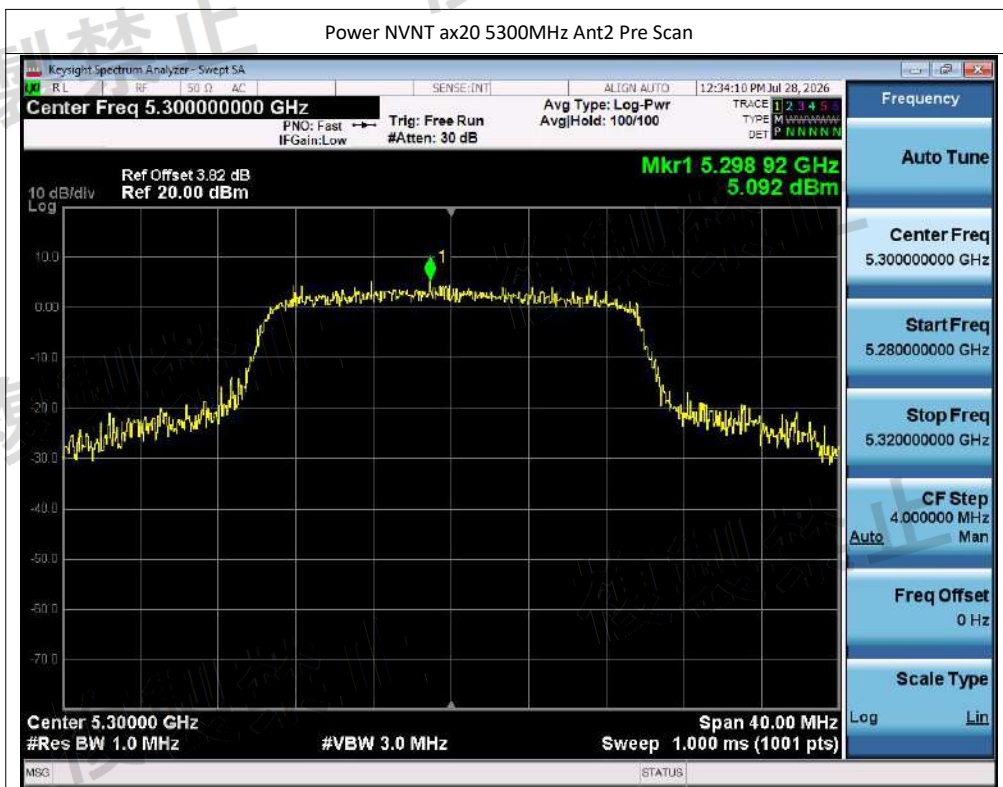


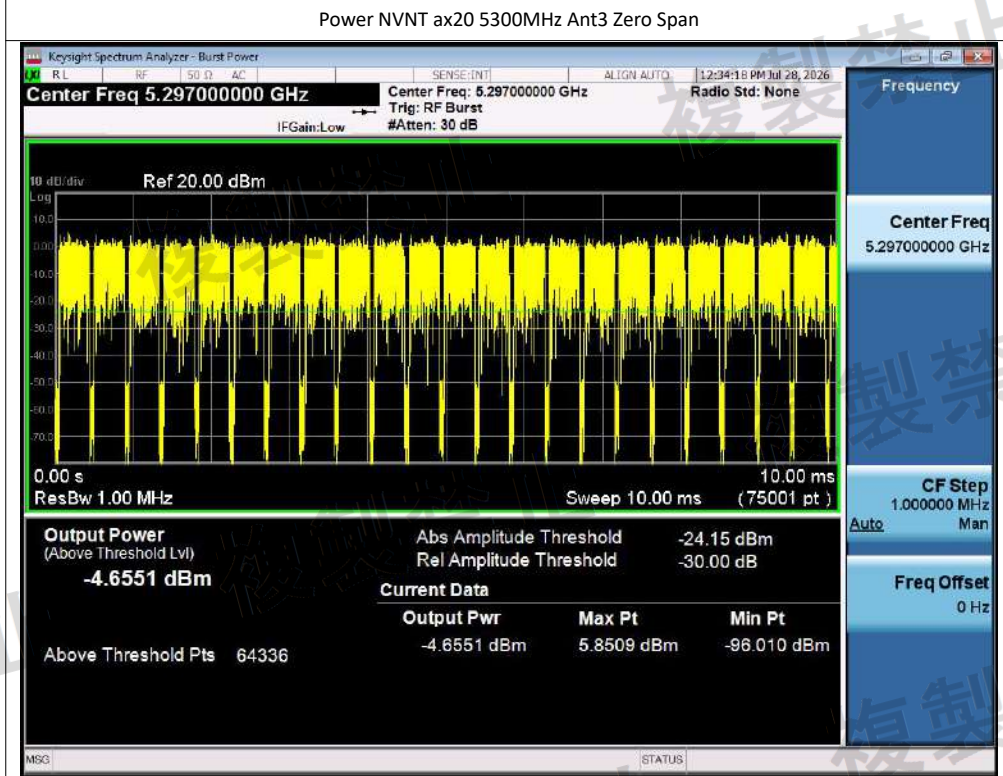








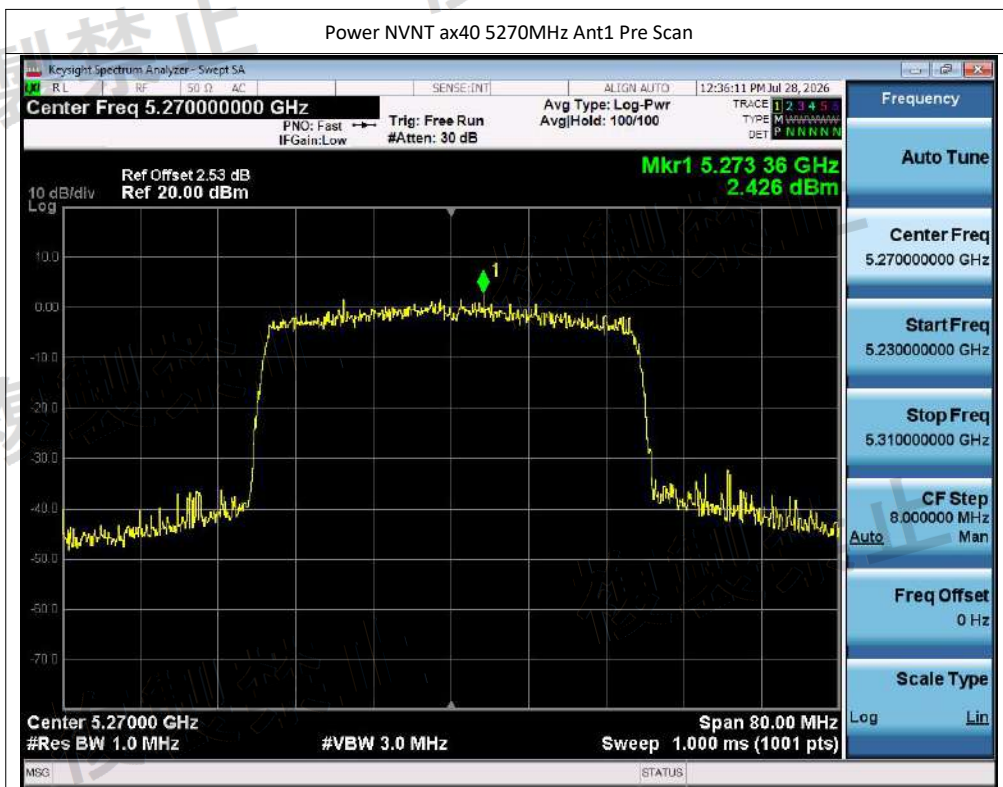

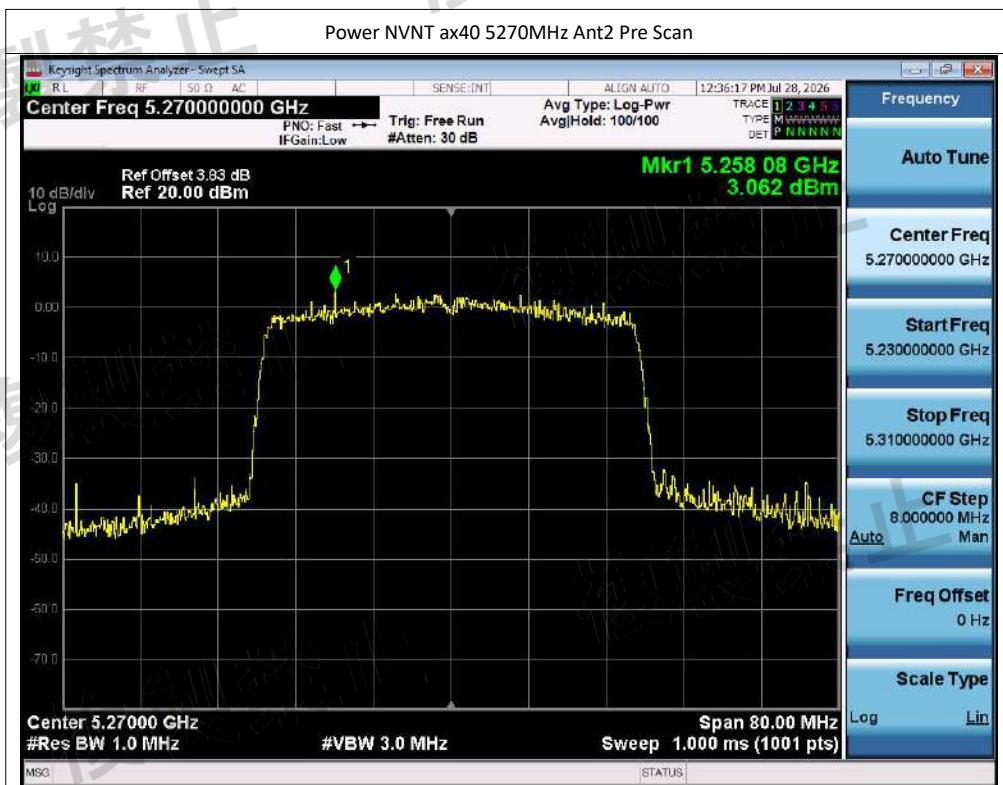
















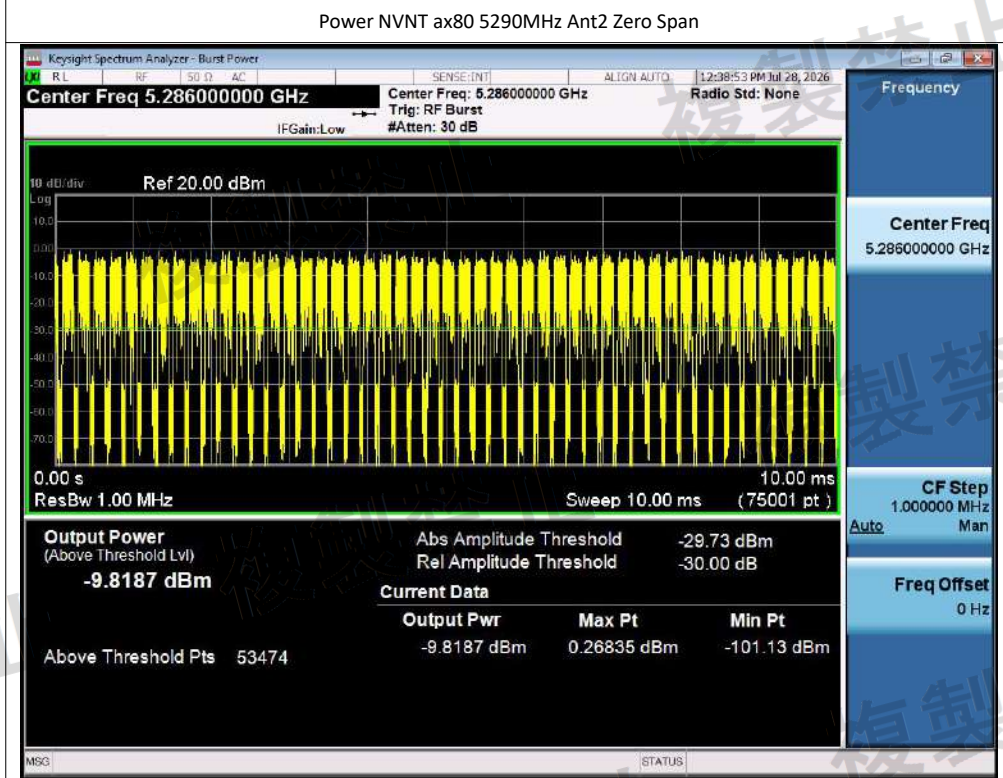




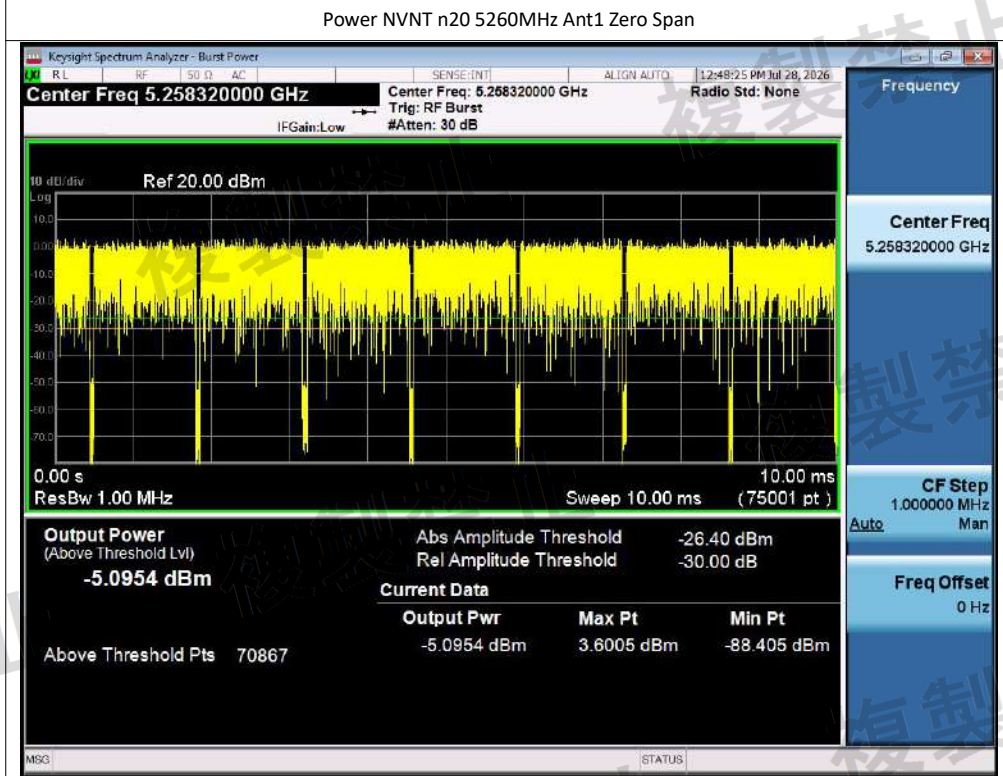

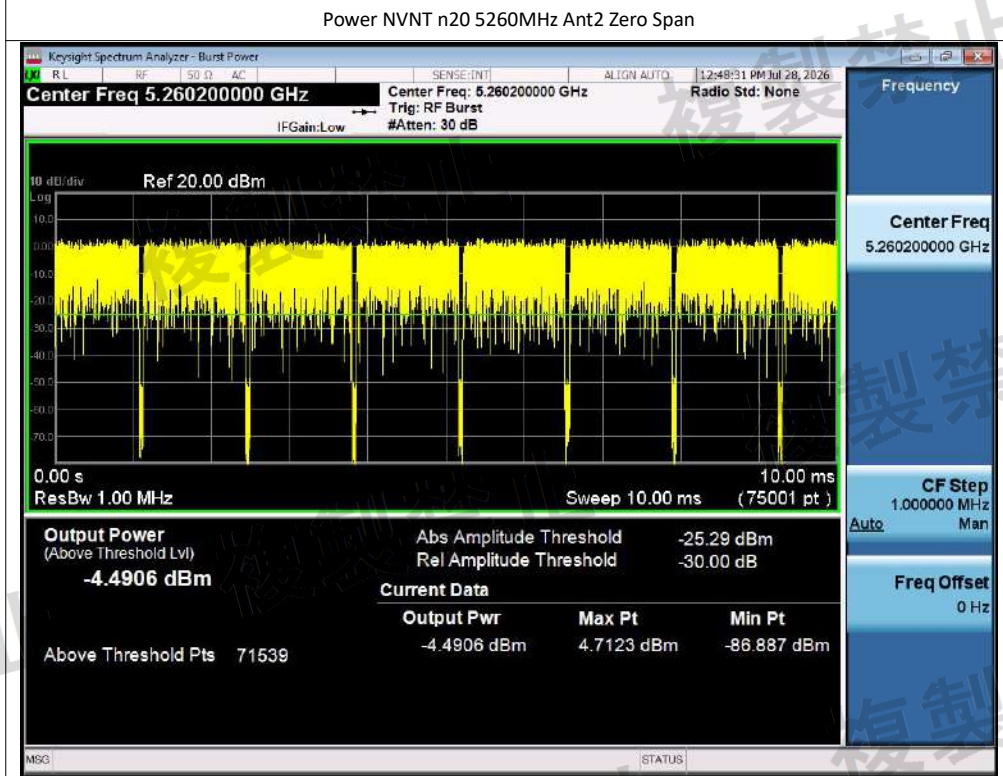


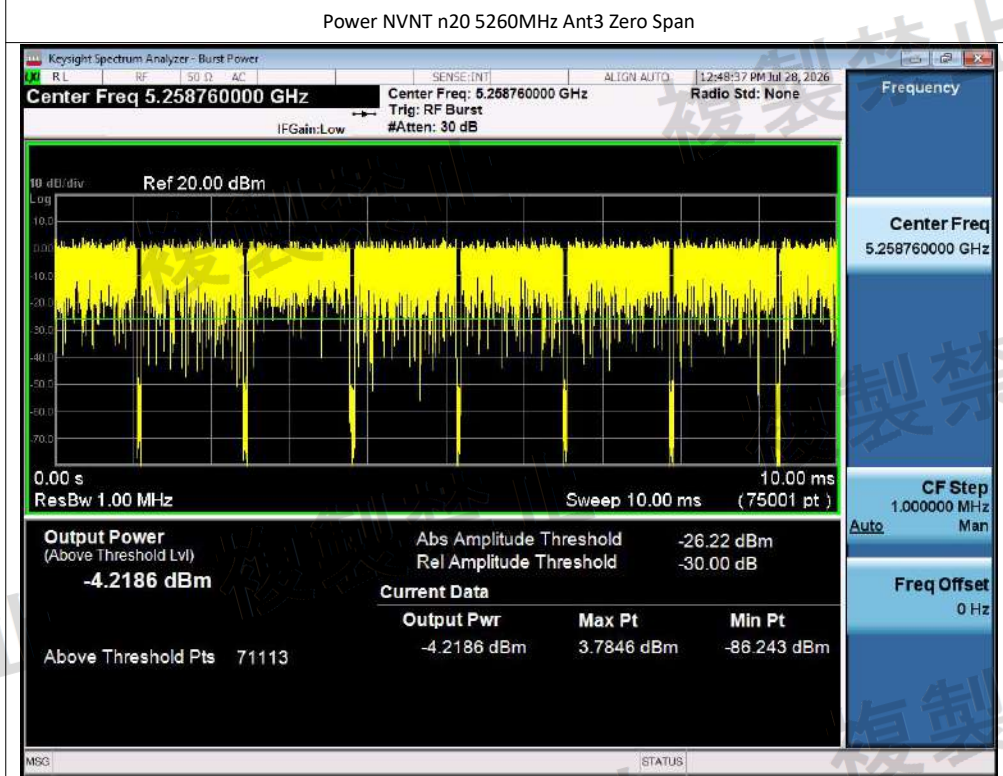
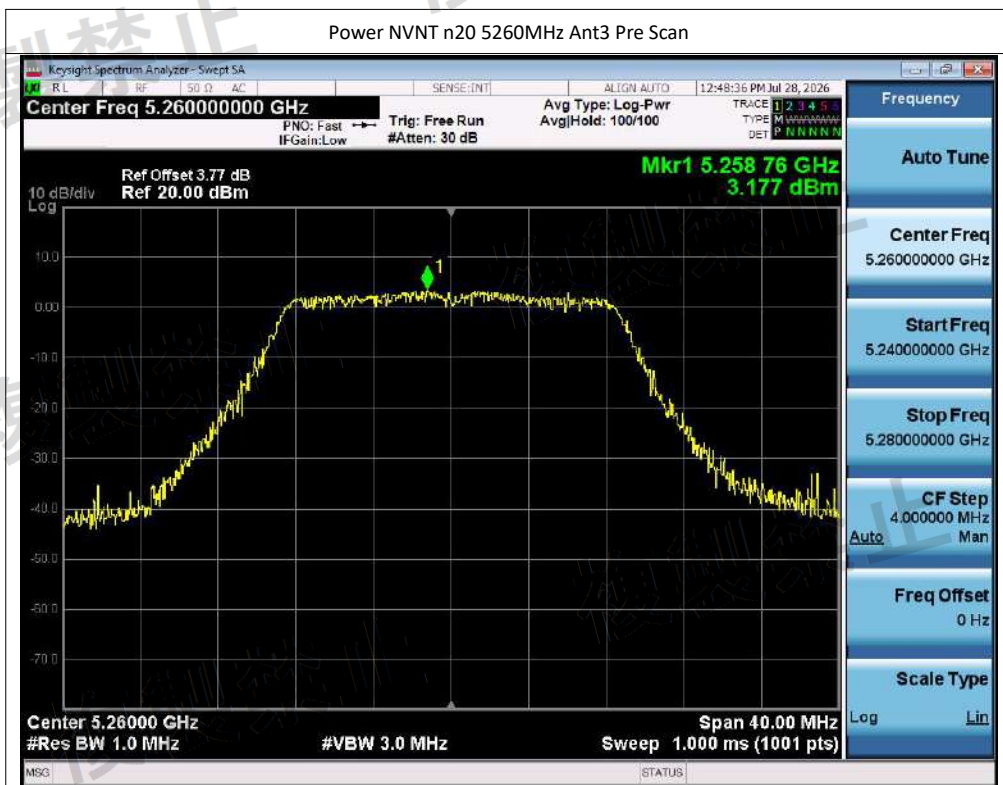






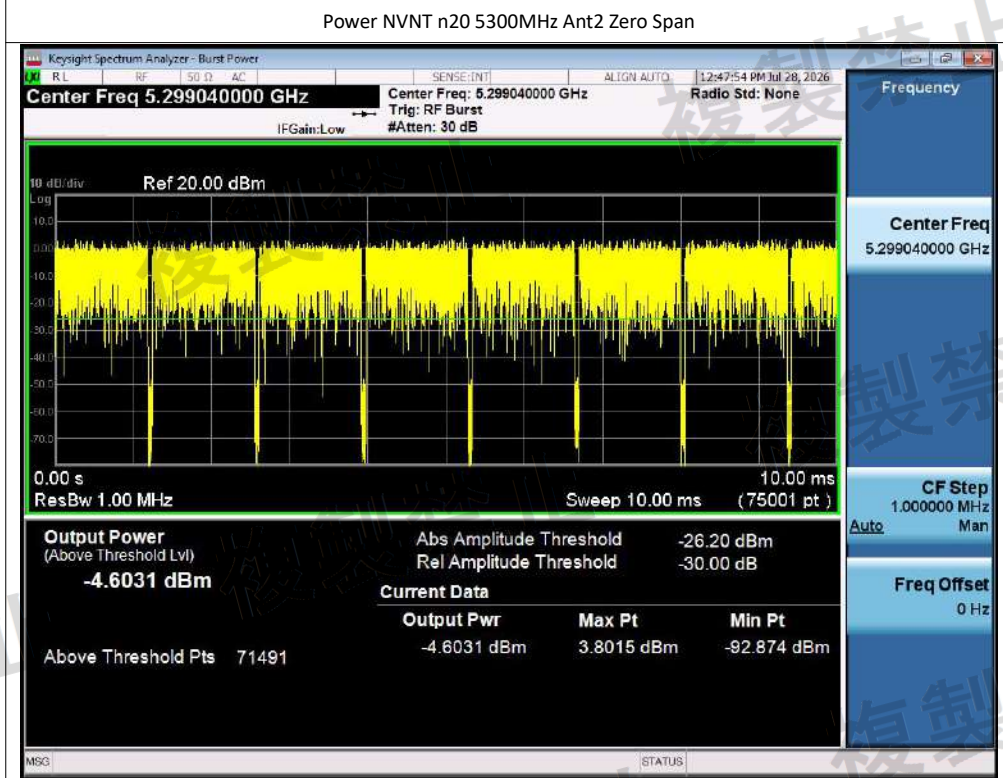






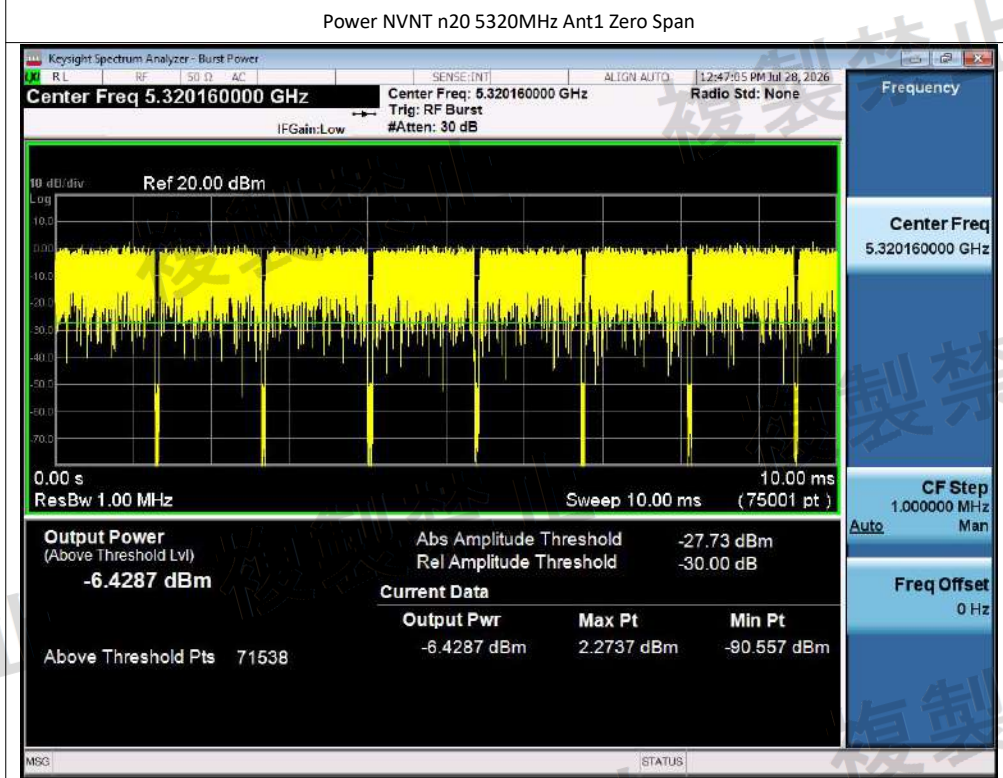


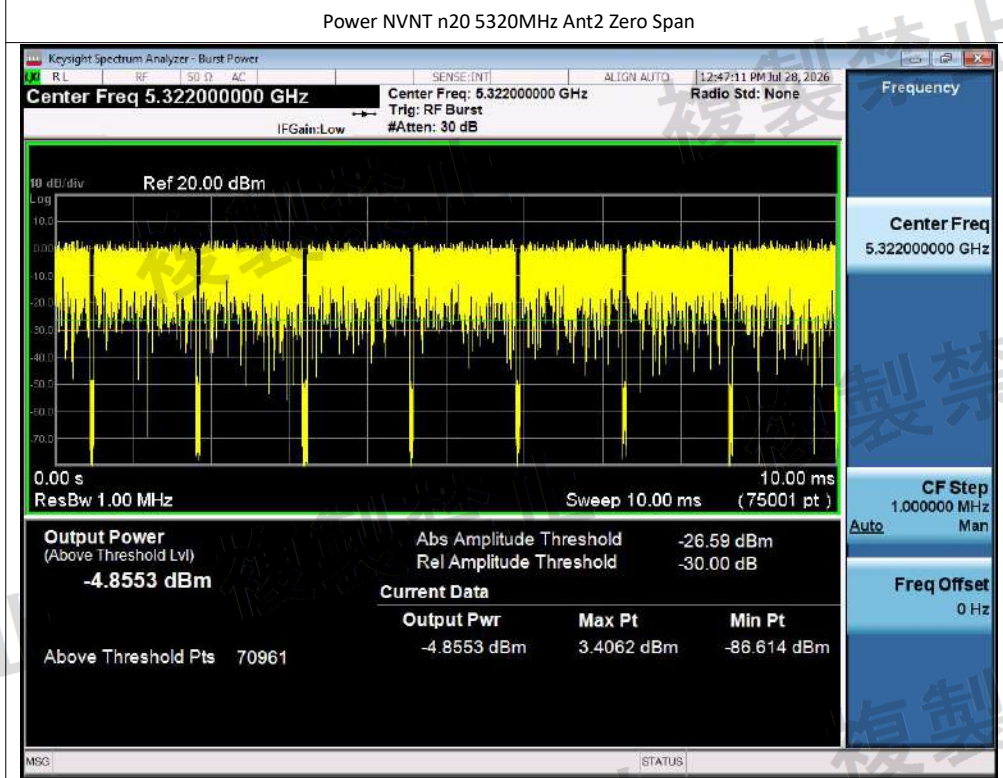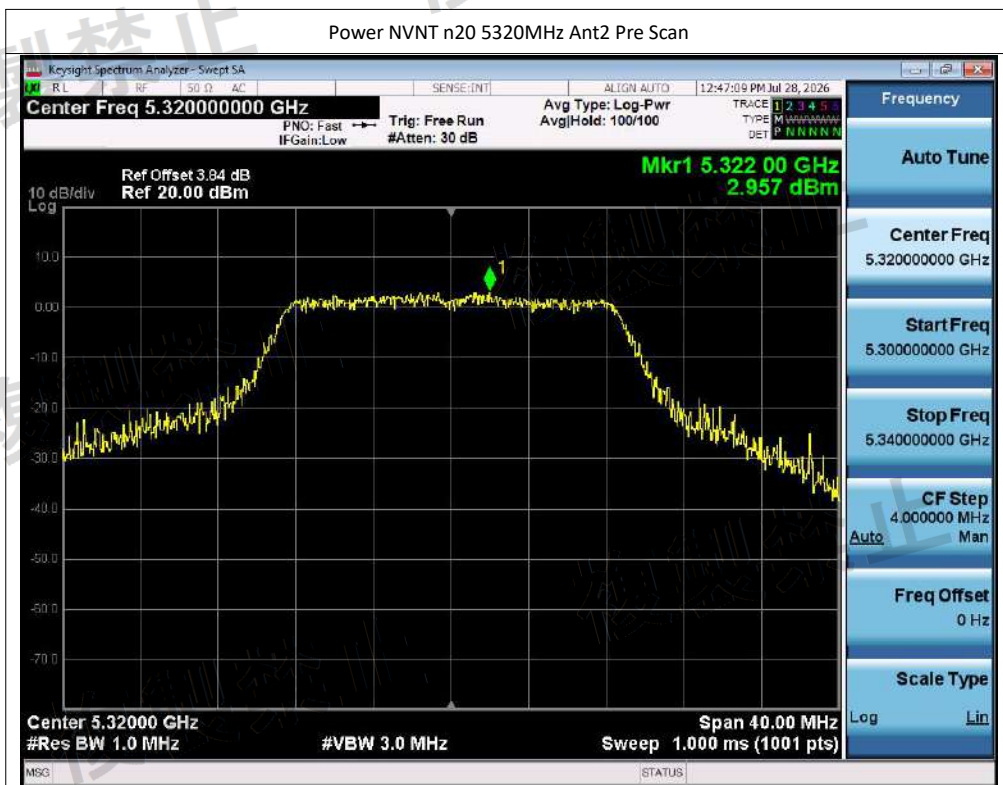


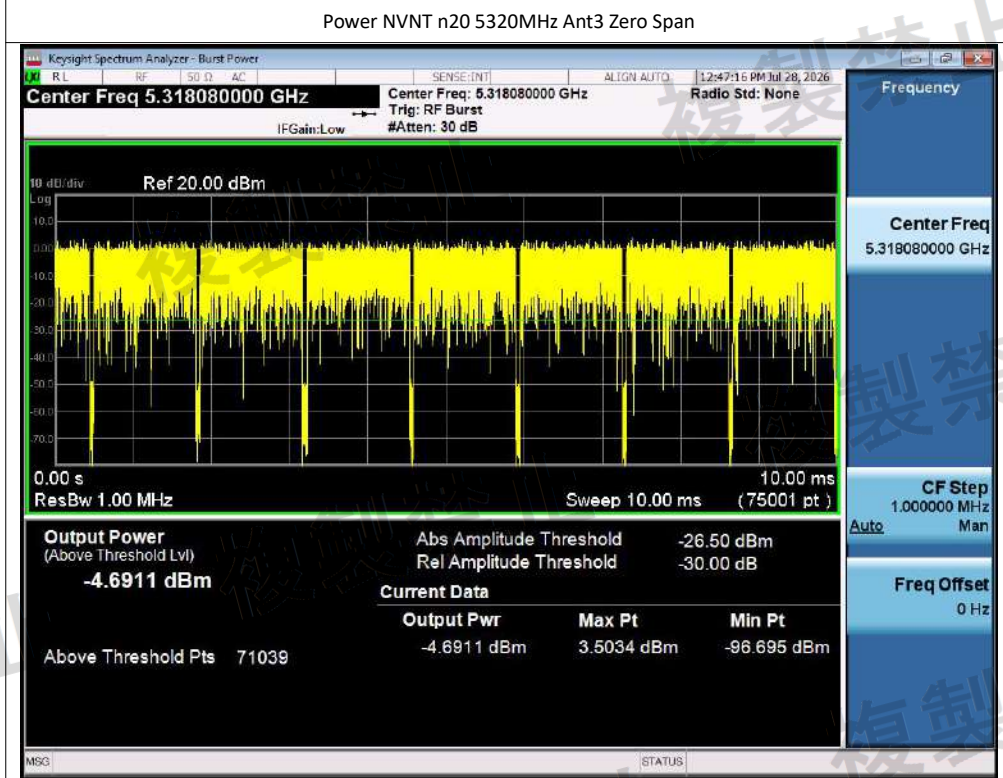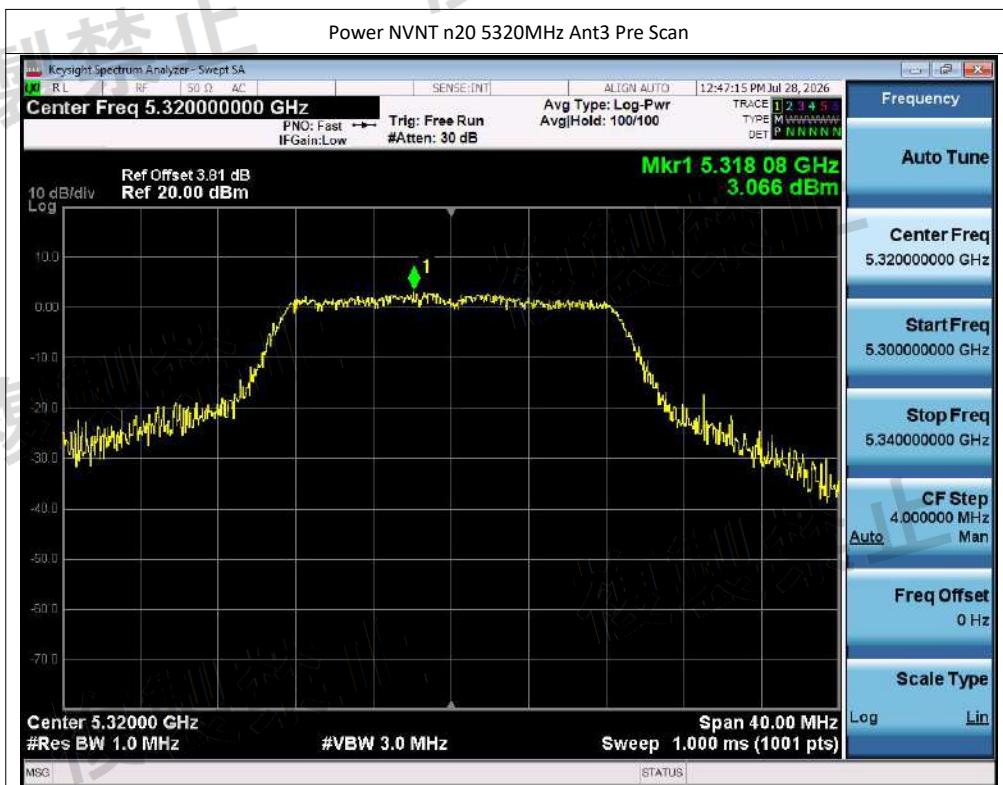


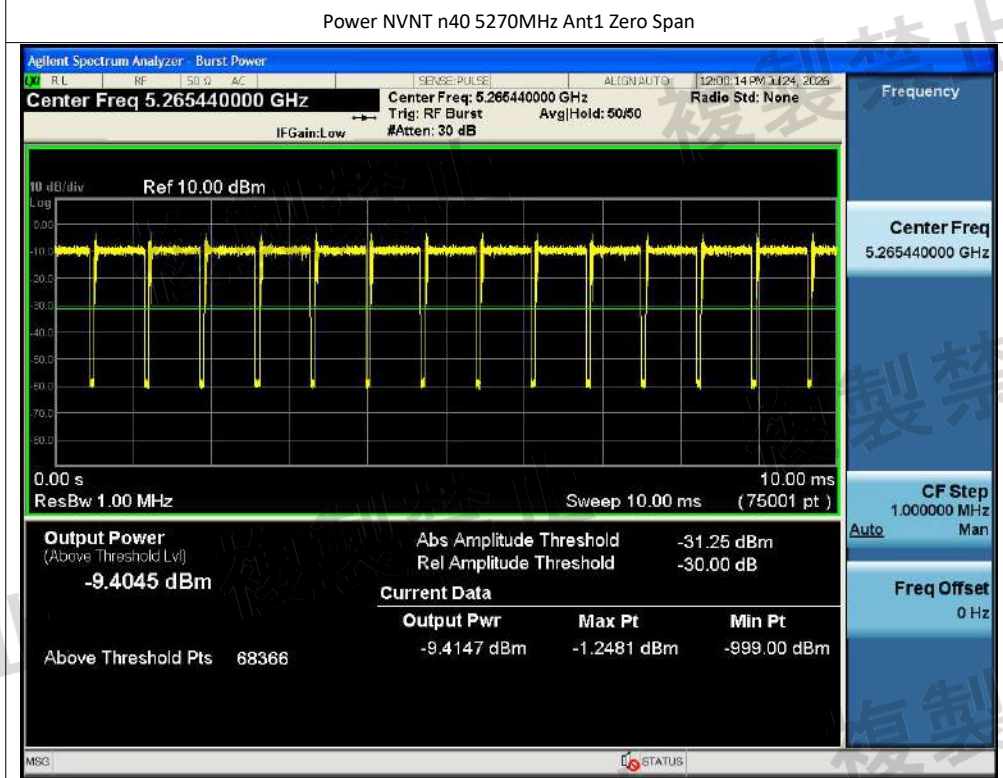

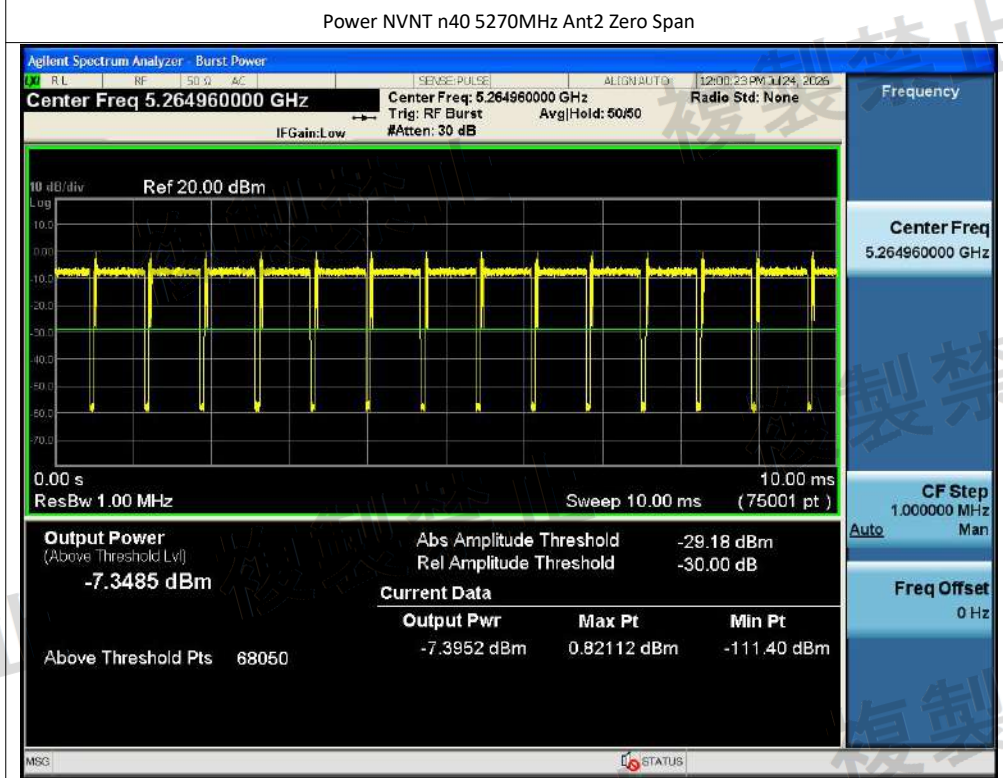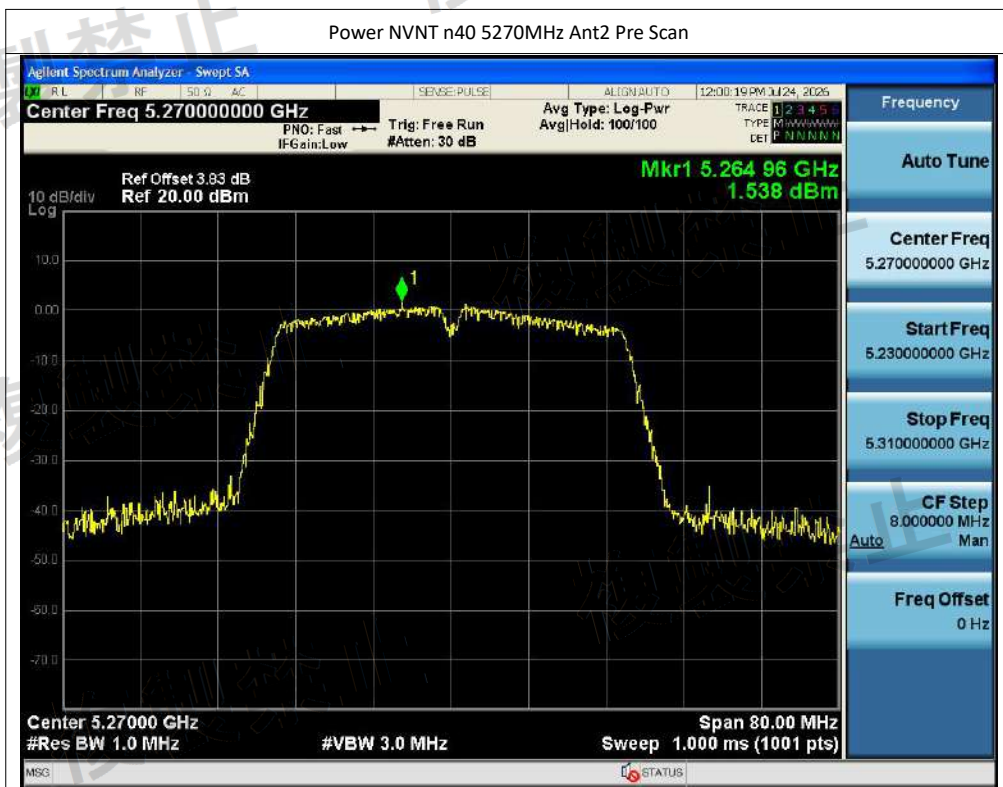

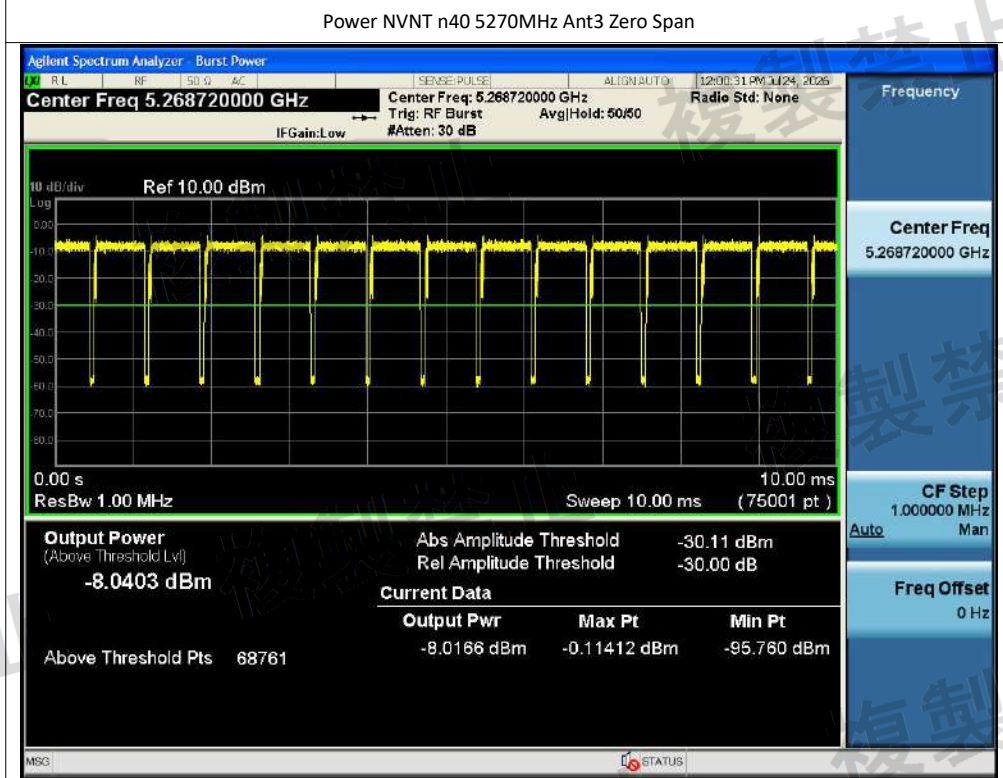

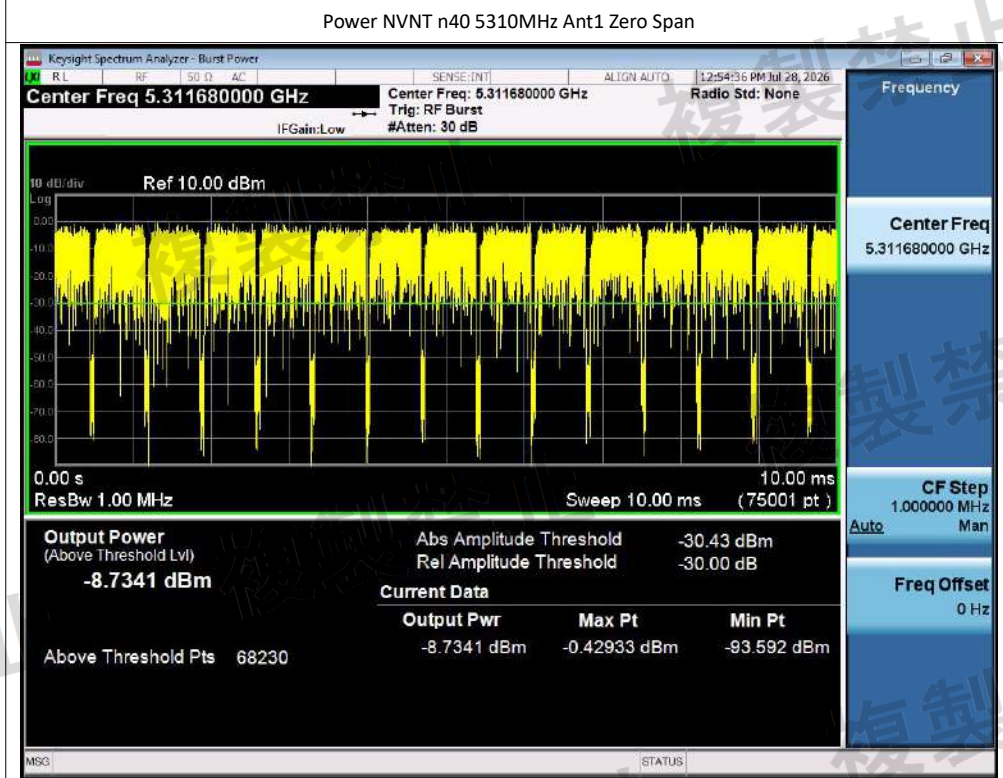

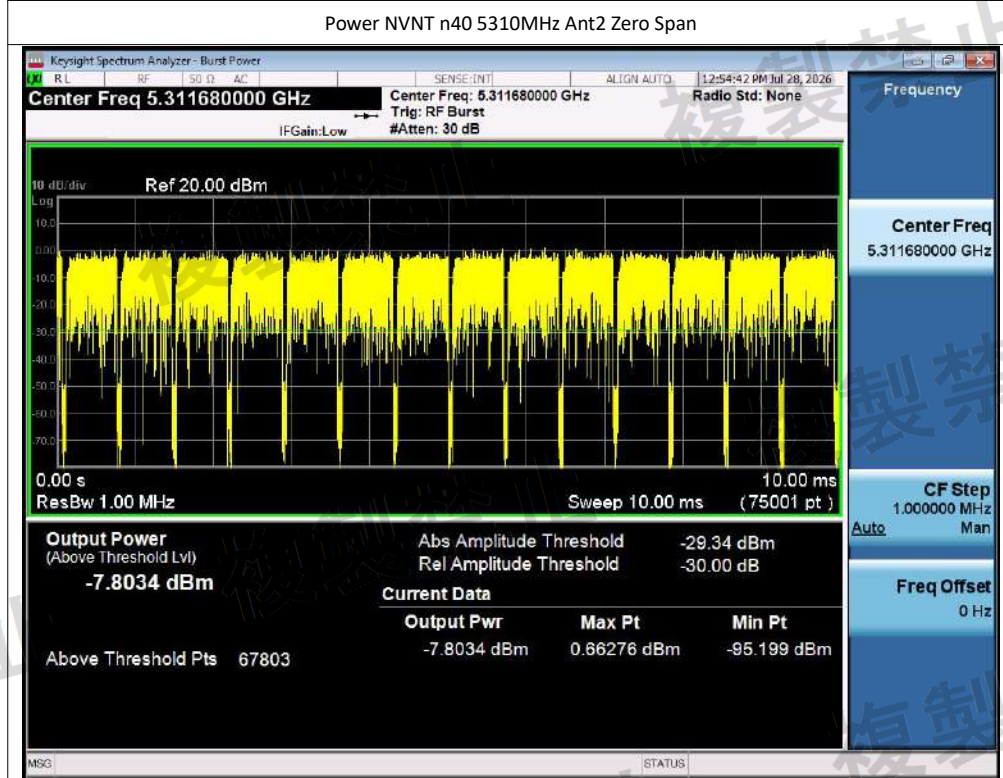



EIRP Power

Condition	Mode	Frequency (MHz)	Antenna	Power (dBm/MHz)	Power (mW/MHz)	Gain (dBi)	EIRP (dBm/MHz)	EIRP (mW/MHz)	Limit (mW/MHz)	Verdict
NVNT	a	5260	Ant1	0.24	1.057	6.18	6.42	4.385	5	Pass
NVNT	a	5300	Ant1	-0.43	0.906	6.18	5.75	3.758	5	Pass
NVNT	a	5320	Ant1	-0.04	0.991	6.18	6.14	4.111	5	Pass
NVNT	a	5260	Ant2	-0.61	0.869	6.2	5.59	3.622	5	Pass
NVNT	a	5300	Ant2	-0.35	0.923	6.2	5.85	3.846	5	Pass
NVNT	a	5320	Ant2	-0.26	0.942	6.2	5.94	3.926	5	Pass
NVNT	a	5260	Ant3	-0.71	0.849	6.9	6.19	4.159	5	Pass
NVNT	a	5300	Ant3	-0.58	0.875	6.9	6.32	4.285	5	Pass
NVNT	a	5320	Ant3	-0.32	0.929	6.9	6.58	4.550	5	Pass
NVNT	ac20	5260	Ant1	-6.17	0.242	6.18	0.01	1.002	5	Pass
NVNT	ac20	5260	Ant2	-3.67	0.43	6.2	2.53	1.791	5	Pass
NVNT	ac20	5260	Ant3	-5.64	0.273	6.9	1.26	1.337	5	Pass
NVNT	ac20	5260	Sum	-0.25	0.945	NaN	6.16	4.130	5	Pass
NVNT	ac20	5300	Ant1	-5.54	0.279	6.18	0.64	1.159	5	Pass
NVNT	ac20	5300	Ant2	-4.44	0.36	6.2	1.76	1.500	5	Pass
NVNT	ac20	5300	Ant3	-5	0.316	6.9	1.9	1.549	5	Pass
NVNT	ac20	5300	Sum	-0.20	0.955	NaN	6.24	4.207	5	Pass
NVNT	ac20	5320	Ant1	-5.24	0.299	6.18	0.94	1.242	5	Pass
NVNT	ac20	5320	Ant2	-4.62	0.345	6.2	1.58	1.439	5	Pass
NVNT	ac20	5320	Ant3	-5.12	0.308	6.9	1.78	1.507	5	Pass
NVNT	ac20	5320	Sum	-0.21	0.952	NaN	6.22	4.187	5	Pass
NVNT	ac40	5270	Ant1	-8.53	0.14	6.18	-2.35	0.582	2.5	Pass
NVNT	ac40	5270	Ant2	-8.13	0.154	6.2	-1.93	0.641	2.5	Pass
NVNT	ac40	5270	Ant3	-8.37	0.146	6.9	-1.47	0.713	2.5	Pass
NVNT	ac40	5270	Sum	-3.57	0.44	NaN	2.87	1.936	2.5	Pass
NVNT	ac40	5310	Ant1	-8.33	0.147	6.18	-2.15	0.610	2.5	Pass
NVNT	ac40	5310	Ant2	-7.96	0.16	6.2	-1.76	0.667	2.5	Pass
NVNT	ac40	5310	Ant3	-8.03	0.157	6.9	-1.13	0.771	2.5	Pass
NVNT	ac40	5310	Sum	-3.33	0.464	NaN	3.11	2.047	2.5	Pass
NVNT	ac80	5290	Ant1	-12.24	0.06	6.18	-6.06	0.248	1.25	Pass
NVNT	ac80	5290	Ant2	-10.38	0.092	6.2	-4.18	0.382	1.25	Pass
NVNT	ac80	5290	Ant3	-10.62	0.087	6.9	-3.72	0.425	1.25	Pass
NVNT	ac80	5290	Sum	-6.22	0.239	NaN	0.23	1.054	1.25	Pass
NVNT	ax20	5260	Ant1	-5.57	0.277	6.18	0.61	1.151	5	Pass
NVNT	ax20	5260	Ant2	-3.95	0.403	6.2	2.25	1.679	5	Pass
NVNT	ax20	5260	Ant3	-4.63	0.344	6.9	2.27	1.687	5	Pass
NVNT	ax20	5260	Sum	0.10	1.024	NaN	6.55	4.516	5	Pass
NVNT	ax20	5300	Ant1	-6.52	0.223	6.18	-0.34	0.925	5	Pass

NVNT	ax20	5300	Ant2	-4.39	0.364	6.2	1.81	1.517	5	Pass
NVNT	ax20	5300	Ant3	-4.66	0.342	6.9	2.24	1.675	5	Pass
NVNT	ax20	5300	Sum	-0.32	0.929	NaN	6.15	4.117	5	Pass
NVNT	ax20	5320	Ant1	-6.39	0.23	6.18	-0.21	0.953	5	Pass
NVNT	ax20	5320	Ant2	-5.17	0.304	6.2	1.03	1.268	5	Pass
NVNT	ax20	5320	Ant3	-4.74	0.336	6.9	2.16	1.644	5	Pass
NVNT	ax20	5320	Sum	-0.60	0.87	NaN	5.87	3.865	5	Pass
NVNT	ax40	5270	Ant1	-8.24	0.15	6.18	-2.06	0.622	2.5	Pass
NVNT	ax40	5270	Ant2	-8.48	0.142	6.2	-2.28	0.592	2.5	Pass
NVNT	ax40	5270	Ant3	-7.27	0.187	6.9	-0.37	0.918	2.5	Pass
NVNT	ax40	5270	Sum	-3.20	0.479	NaN	3.29	2.132	2.5	Pass
NVNT	ax40	5310	Ant1	-9.57	0.11	6.18	-3.39	0.458	2.5	Pass
NVNT	ax40	5310	Ant2	-7.38	0.183	6.2	-1.18	0.762	2.5	Pass
NVNT	ax40	5310	Ant3	-7.21	0.19	6.9	-0.31	0.931	2.5	Pass
NVNT	ax40	5310	Sum	-3.16	0.483	NaN	3.33	2.151	2.5	Pass
NVNT	ax80	5290	Ant1	-12.53	0.056	6.18	-6.35	0.232	1.25	Pass
NVNT	ax80	5290	Ant2	-9.82	0.104	6.2	-3.62	0.435	1.25	Pass
NVNT	ax80	5290	Ant3	-11.4	0.072	6.9	-4.5	0.355	1.25	Pass
NVNT	ax80	5290	Sum	-6.35	0.232	NaN	0.09	1.021	1.25	Pass
NVNT	n20	5260	Ant1	-5.1	0.309	6.18	1.08	1.282	5	Pass
NVNT	n20	5260	Ant2	-4.49	0.356	6.2	1.71	1.483	5	Pass
NVNT	n20	5260	Ant3	-4.22	0.378	6.9	2.68	1.854	5	Pass
NVNT	n20	5260	Sum	0.18	1.043	NaN	6.64	4.618	5	Pass
NVNT	n20	5300	Ant1	-5.73	0.267	6.18	0.45	1.109	5	Pass
NVNT	n20	5300	Ant2	-4.6	0.347	6.2	1.6	1.445	5	Pass
NVNT	n20	5300	Ant3	-4.26	0.375	6.9	2.64	1.837	5	Pass
NVNT	n20	5300	Sum	-0.05	0.989	NaN	6.43	4.391	5	Pass
NVNT	n20	5320	Ant1	-6.43	0.228	6.18	-0.25	0.944	5	Pass
NVNT	n20	5320	Ant2	-4.86	0.327	6.2	1.34	1.361	5	Pass
NVNT	n20	5320	Ant3	-4.69	0.34	6.9	2.21	1.663	5	Pass
NVNT	n20	5320	Sum	-0.48	0.895	NaN	5.99	3.969	5	Pass
NVNT	n40	5270	Ant1	-9.4	0.115	6.18	-3.22	0.476	2.5	Pass
NVNT	n40	5270	Ant2	-7.35	0.184	6.2	-1.15	0.767	2.5	Pass
NVNT	n40	5270	Ant3	-8.04	0.157	6.9	-1.14	0.769	2.5	Pass
NVNT	n40	5270	Sum	-3.41	0.456	NaN	3.04	2.013	2.5	Pass
NVNT	n40	5310	Ant1	-8.73	0.134	6.18	-2.55	0.556	2.5	Pass
NVNT	n40	5310	Ant2	-7.8	0.166	6.2	-1.6	0.692	2.5	Pass
NVNT	n40	5310	Ant3	-8.17	0.152	6.9	-1.27	0.746	2.5	Pass
NVNT	n40	5310	Sum	-3.45	0.452	NaN	3.00	1.994	2.5	Pass

Occupied Channel Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	99% OBW (MHz)	Lower Limit (MHz)	Upper Limit (MHz)	Verdict
NVNT	a	5260	Ant1	16.401	N/A	20	Pass
NVNT	a	5300	Ant1	16.562	N/A	20	Pass
NVNT	a	5320	Ant1	16.57	N/A	20	Pass
NVNT	a	5260	Ant2	16.397	N/A	20	Pass
NVNT	a	5300	Ant2	16.599	N/A	20	Pass
NVNT	a	5320	Ant2	16.58	N/A	20	Pass
NVNT	a	5260	Ant3	16.407	N/A	20	Pass
NVNT	a	5300	Ant3	16.56	N/A	20	Pass
NVNT	a	5320	Ant3	16.601	N/A	20	Pass
NVNT	ac20	5260	Ant1	17.583	N/A	20	Pass
NVNT	ac20	5260	Ant2	17.584	N/A	20	Pass
NVNT	ac20	5260	Ant3	17.588	N/A	20	Pass
NVNT	ac20	5300	Ant1	17.774	N/A	20	Pass
NVNT	ac20	5300	Ant2	17.753	N/A	20	Pass
NVNT	ac20	5300	Ant3	17.755	N/A	20	Pass
NVNT	ac20	5320	Ant1	17.756	N/A	20	Pass
NVNT	ac20	5320	Ant2	17.751	N/A	20	Pass
NVNT	ac20	5320	Ant3	17.747	N/A	20	Pass
NVNT	ac40	5270	Ant1	35.858	N/A	40	Pass
NVNT	ac40	5270	Ant2	35.856	N/A	40	Pass
NVNT	ac40	5270	Ant3	35.9	N/A	40	Pass
NVNT	ac40	5310	Ant1	36.079	N/A	40	Pass
NVNT	ac40	5310	Ant2	36.089	N/A	40	Pass
NVNT	ac40	5310	Ant3	36.017	N/A	40	Pass
NVNT	ac80	5290	Ant1	75.484	N/A	80	Pass
NVNT	ac80	5290	Ant2	75.414	N/A	80	Pass
NVNT	ac80	5290	Ant3	75.363	N/A	80	Pass
NVNT	ax20	5260	Ant1	18.935	N/A	20	Pass
NVNT	ax20	5260	Ant2	18.931	N/A	20	Pass
NVNT	ax20	5260	Ant3	18.929	N/A	20	Pass
NVNT	ax20	5300	Ant1	19.045	N/A	20	Pass
NVNT	ax20	5300	Ant2	19.038	N/A	20	Pass
NVNT	ax20	5300	Ant3	19.045	N/A	20	Pass
NVNT	ax20	5320	Ant1	19.047	N/A	20	Pass
NVNT	ax20	5320	Ant2	19.042	N/A	20	Pass
NVNT	ax20	5320	Ant3	19.05	N/A	20	Pass
NVNT	ax40	5270	Ant1	37.503	N/A	40	Pass
NVNT	ax40	5270	Ant2	37.495	N/A	40	Pass
NVNT	ax40	5270	Ant3	37.538	N/A	40	Pass

NVNT	ax40	5310	Ant1	37.639	N/A	40	Pass
NVNT	ax40	5310	Ant2	37.651	N/A	40	Pass
NVNT	ax40	5310	Ant3	37.629	N/A	40	Pass
NVNT	ax80	5290	Ant1	77.044	N/A	80	Pass
NVNT	ax80	5290	Ant2	76.965	N/A	80	Pass
NVNT	ax80	5290	Ant3	76.914	N/A	80	Pass
NVNT	n20	5260	Ant1	17.607	N/A	20	Pass
NVNT	n20	5260	Ant2	17.604	N/A	20	Pass
NVNT	n20	5260	Ant3	17.614	N/A	20	Pass
NVNT	n20	5300	Ant1	17.767	N/A	20	Pass
NVNT	n20	5300	Ant2	17.767	N/A	20	Pass
NVNT	n20	5300	Ant3	17.745	N/A	20	Pass
NVNT	n20	5320	Ant1	17.776	N/A	20	Pass
NVNT	n20	5320	Ant2	17.786	N/A	20	Pass
NVNT	n20	5320	Ant3	17.763	N/A	20	Pass
NVNT	n40	5270	Ant1	35.872	N/A	40	Pass
NVNT	n40	5270	Ant2	35.851	N/A	40	Pass
NVNT	n40	5270	Ant3	35.863	N/A	40	Pass
NVNT	n40	5310	Ant1	36.092	N/A	40	Pass
NVNT	n40	5310	Ant2	36.013	N/A	40	Pass
NVNT	n40	5310	Ant3	36.012	N/A	40	Pass

Test Graphs

OBW NVNT a 5260MHz Ant1



OBW NVNT a 5300MHz Ant1





















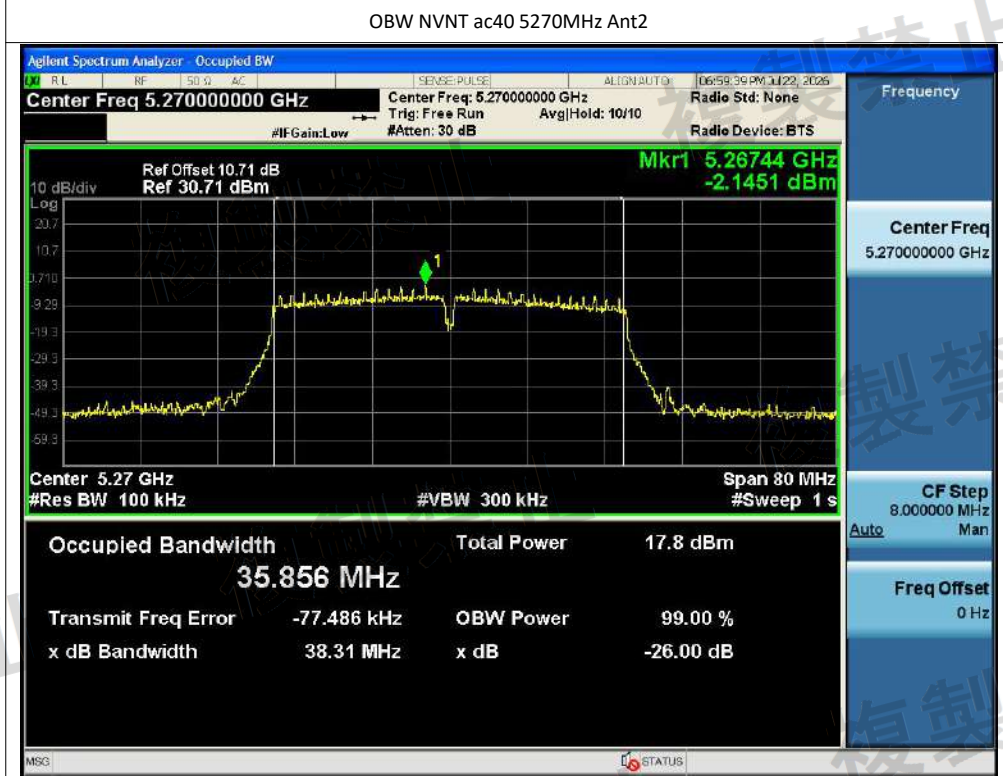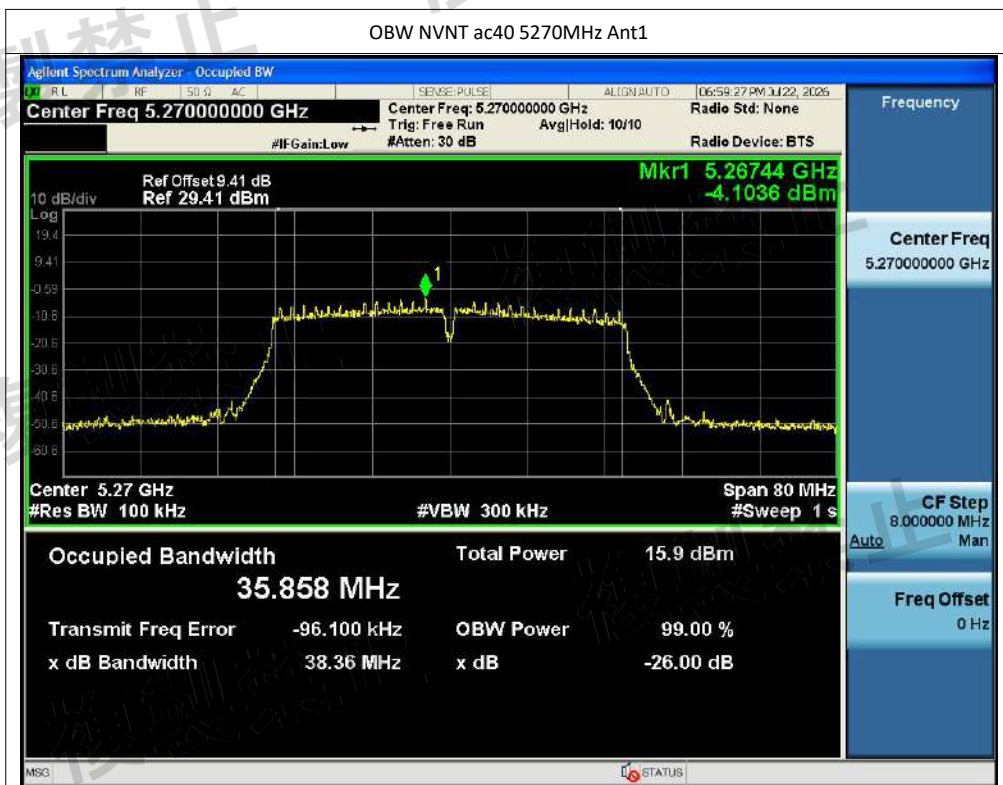





















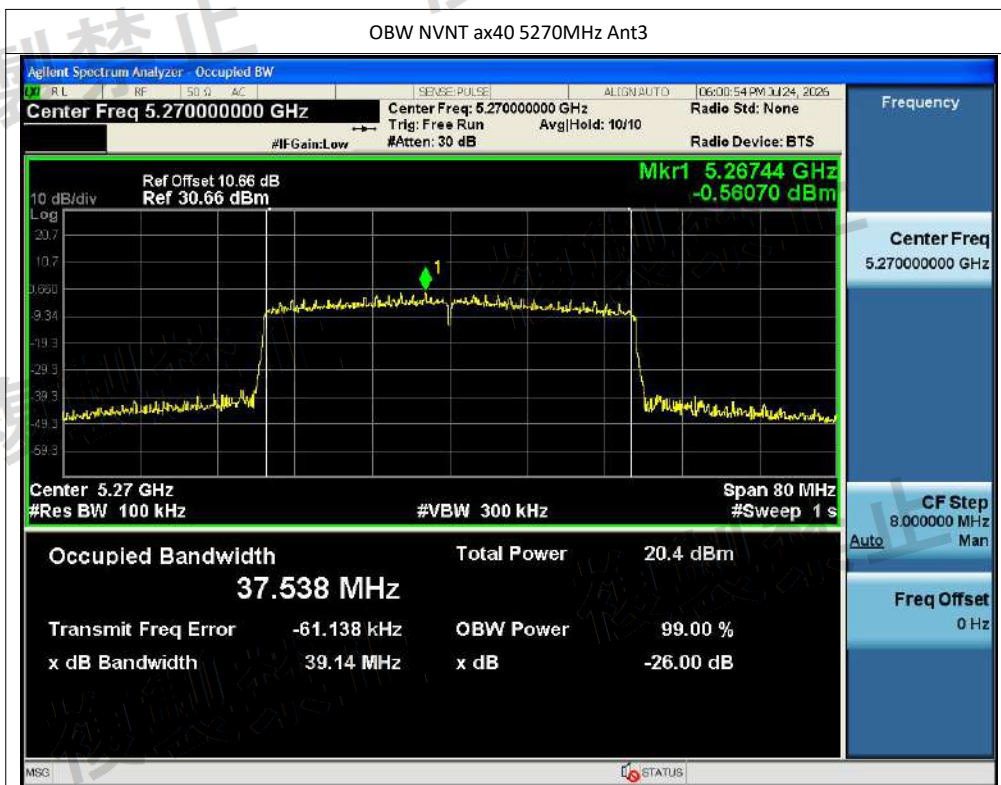









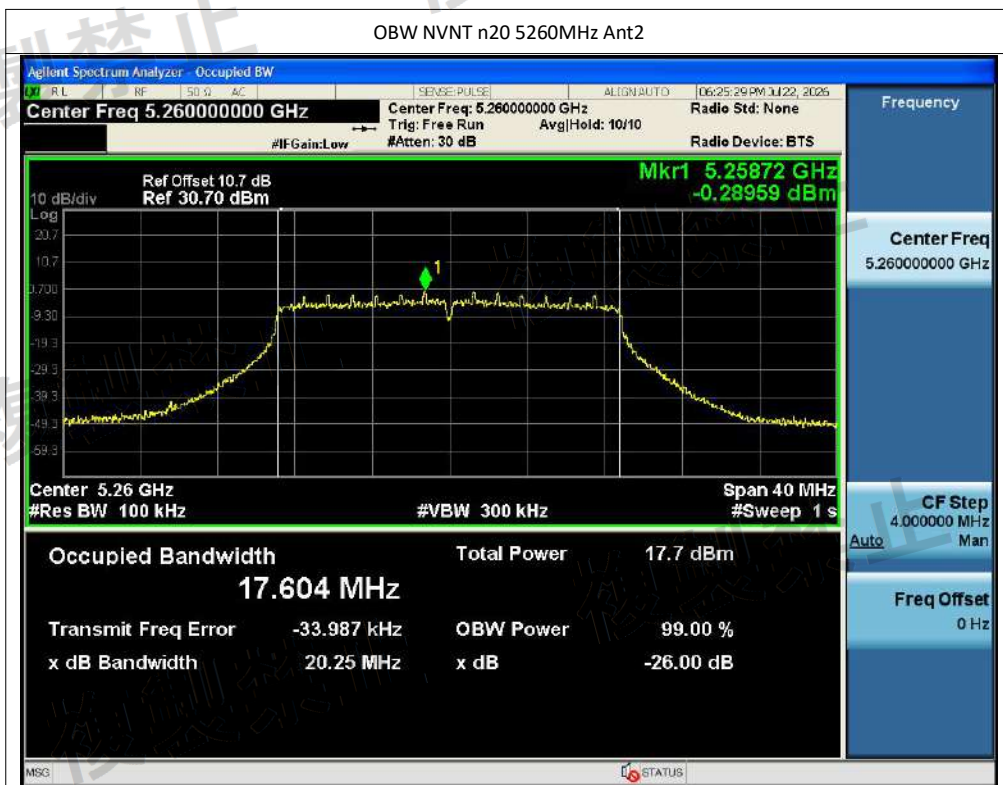

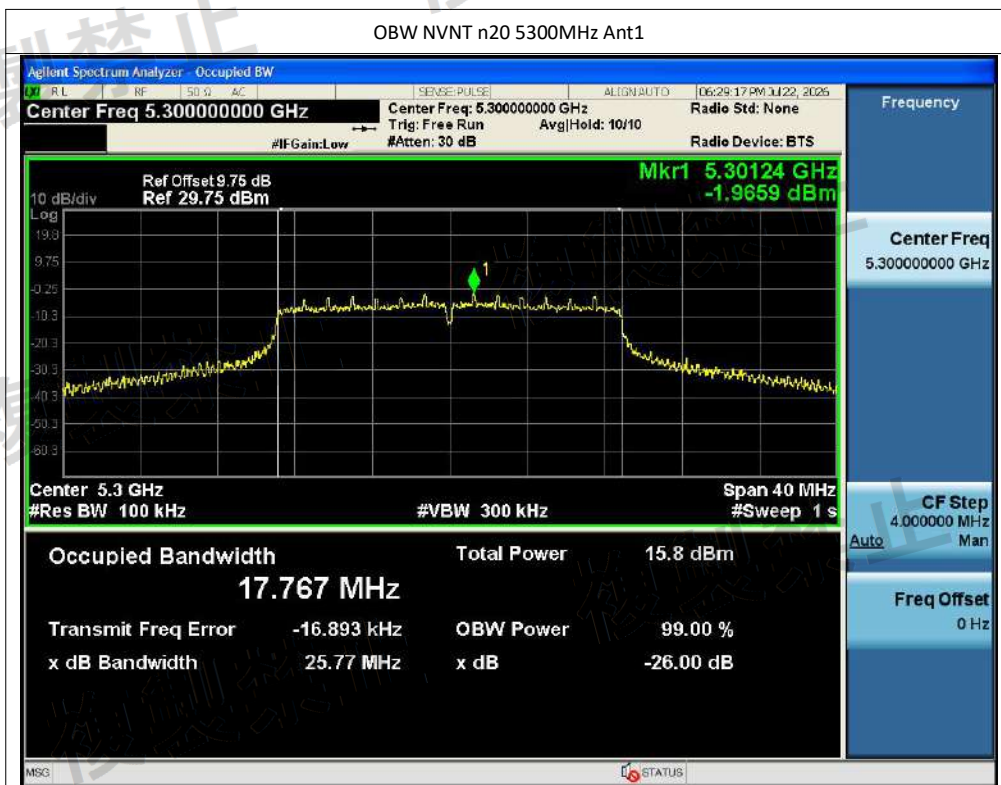

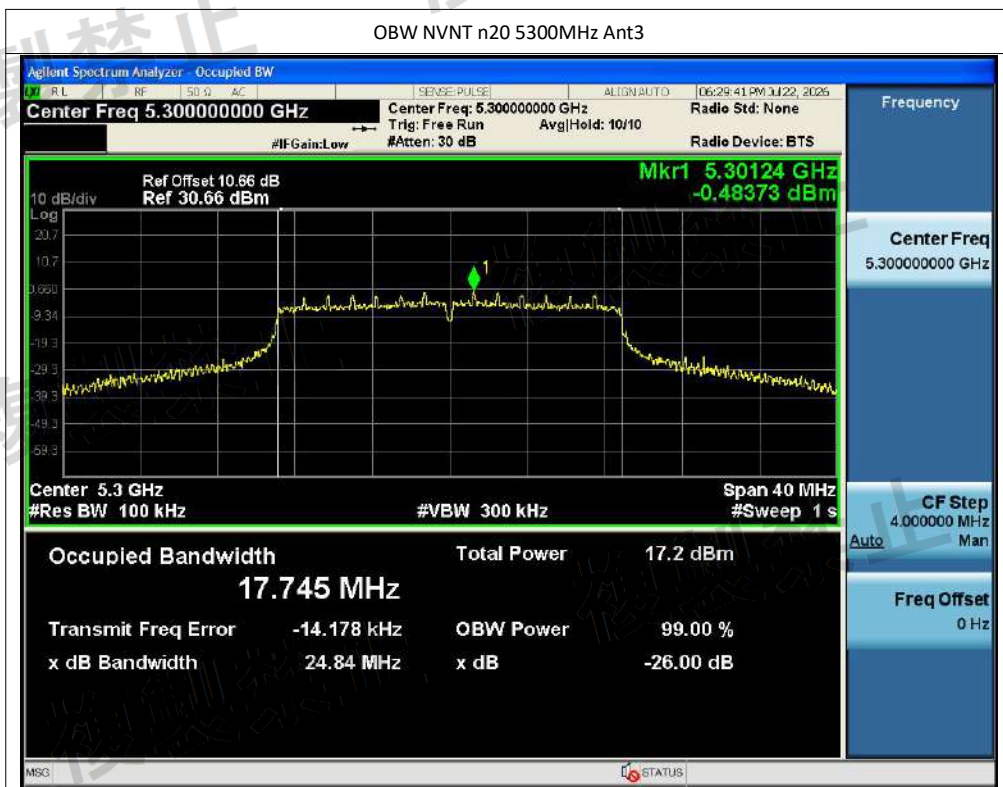









Spreading Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	90% OBW (MHz)
NVNT	a	5260	Ant1	14.539
NVNT	a	5300	Ant1	14.67
NVNT	a	5320	Ant1	14.604
NVNT	a	5260	Ant2	14.493
NVNT	a	5300	Ant2	14.678
NVNT	a	5320	Ant2	14.651
NVNT	a	5260	Ant3	14.579
NVNT	a	5300	Ant3	14.638
NVNT	a	5320	Ant3	14.727
NVNT	ac20	5260	Ant1	15.595
NVNT	ac20	5260	Ant2	15.437
NVNT	ac20	5260	Ant3	15.492
NVNT	ac20	5300	Ant1	15.707
NVNT	ac20	5300	Ant2	15.639
NVNT	ac20	5300	Ant3	15.612
NVNT	ac20	5320	Ant1	15.745
NVNT	ac20	5320	Ant2	15.675
NVNT	ac20	5320	Ant3	15.655
NVNT	ac40	5270	Ant1	30.785
NVNT	ac40	5270	Ant2	30.691
NVNT	ac40	5270	Ant3	31.054
NVNT	ac40	5310	Ant1	30.982
NVNT	ac40	5310	Ant2	30.771
NVNT	ac40	5310	Ant3	30.991
NVNT	ac80	5290	Ant1	66.048
NVNT	ac80	5290	Ant2	65.443
NVNT	ac80	5290	Ant3	65.102
NVNT	ax20	5260	Ant1	16.692
NVNT	ax20	5260	Ant2	16.783
NVNT	ax20	5260	Ant3	16.747
NVNT	ax20	5300	Ant1	16.752
NVNT	ax20	5300	Ant2	16.694
NVNT	ax20	5300	Ant3	16.527
NVNT	ax20	5320	Ant1	16.829
NVNT	ax20	5320	Ant2	16.995
NVNT	ax20	5320	Ant3	16.919
NVNT	ax40	5270	Ant1	32.05
NVNT	ax40	5270	Ant2	32.157
NVNT	ax40	5270	Ant3	32.585

NVNT	ax40	5310	Ant1	32.343
NVNT	ax40	5310	Ant2	31.862
NVNT	ax40	5310	Ant3	32.141
NVNT	ax80	5290	Ant1	66.638
NVNT	ax80	5290	Ant2	66.393
NVNT	ax80	5290	Ant3	65.965
NVNT	n20	5260	Ant1	15.57
NVNT	n20	5260	Ant2	15.565
NVNT	n20	5260	Ant3	15.624
NVNT	n20	5300	Ant1	15.708
NVNT	n20	5300	Ant2	15.628
NVNT	n20	5300	Ant3	15.612
NVNT	n20	5320	Ant1	15.72
NVNT	n20	5320	Ant2	15.593
NVNT	n20	5320	Ant3	15.608
NVNT	n40	5270	Ant1	30.864
NVNT	n40	5270	Ant2	30.893
NVNT	n40	5270	Ant3	30.868
NVNT	n40	5310	Ant1	31.019
NVNT	n40	5310	Ant2	30.864
NVNT	n40	5310	Ant3	30.905


Test Graphs


Spreading Bandwidth NVNT a 5260MHz Ant1




Spreading Bandwidth NVNT a 5300MHz Ant1



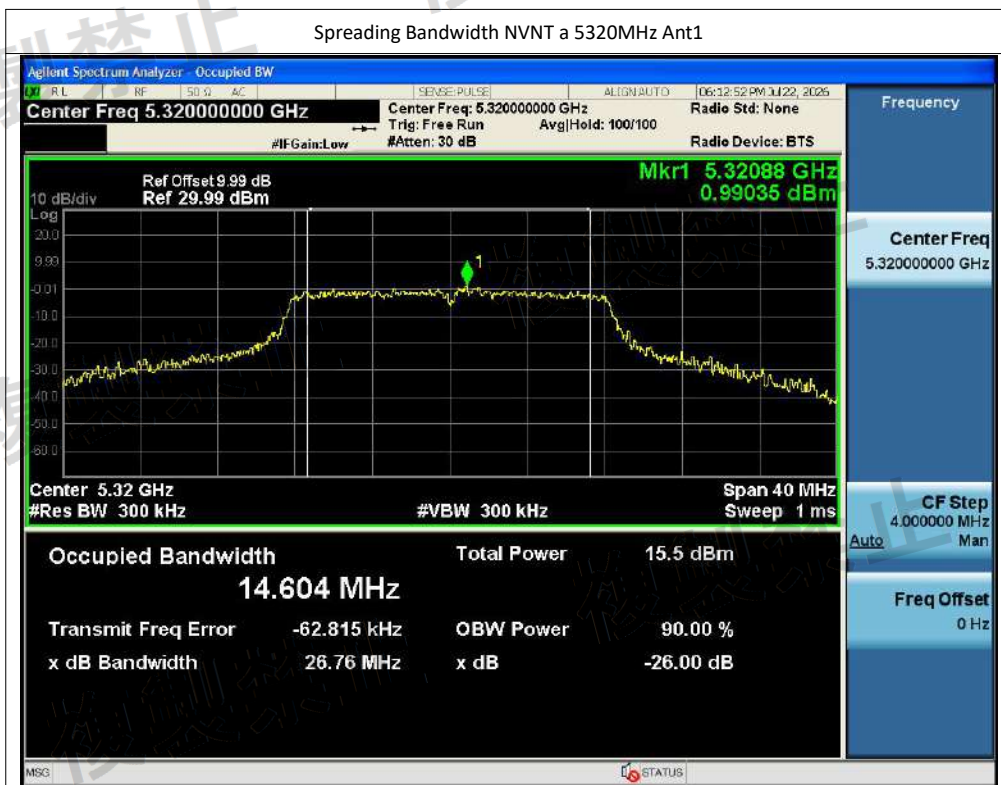

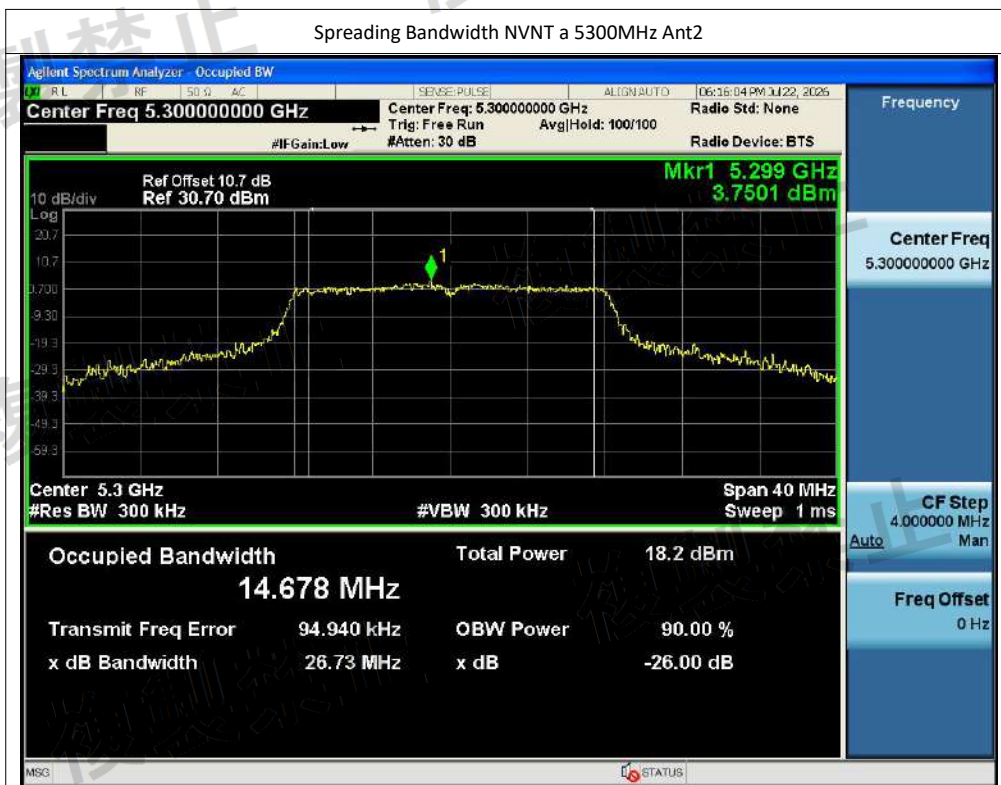


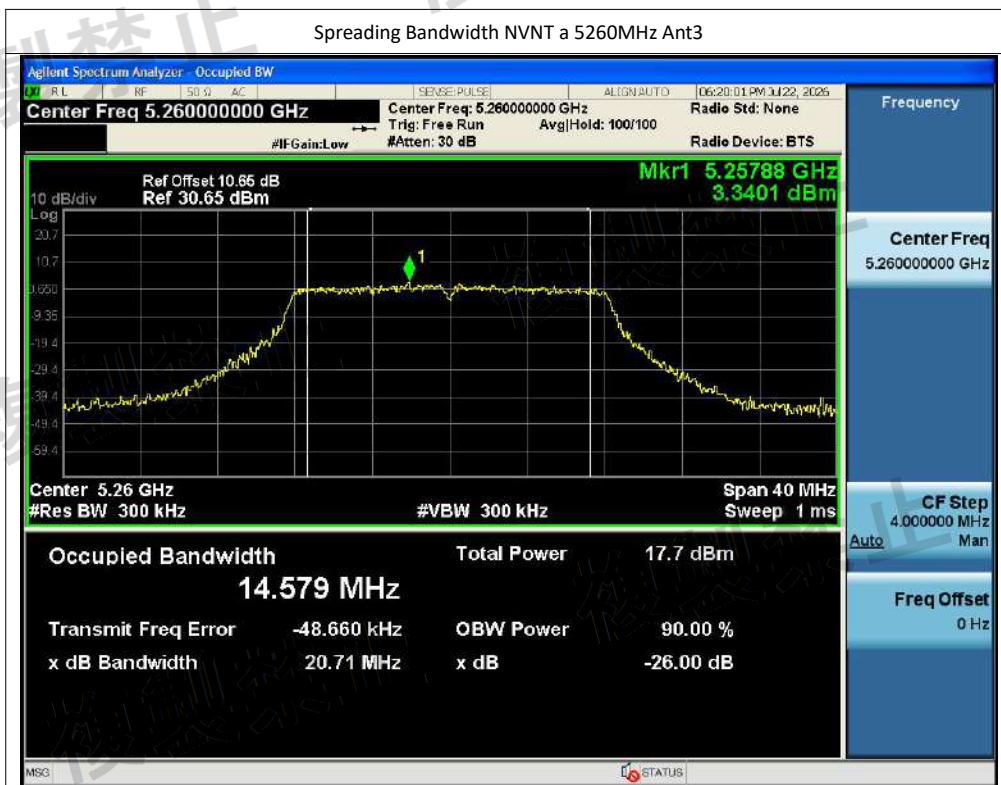


Spreading Bandwidth NVNT a 5320MHz Ant3



Spreading Bandwidth NVNT ac20 5260MHz Ant1



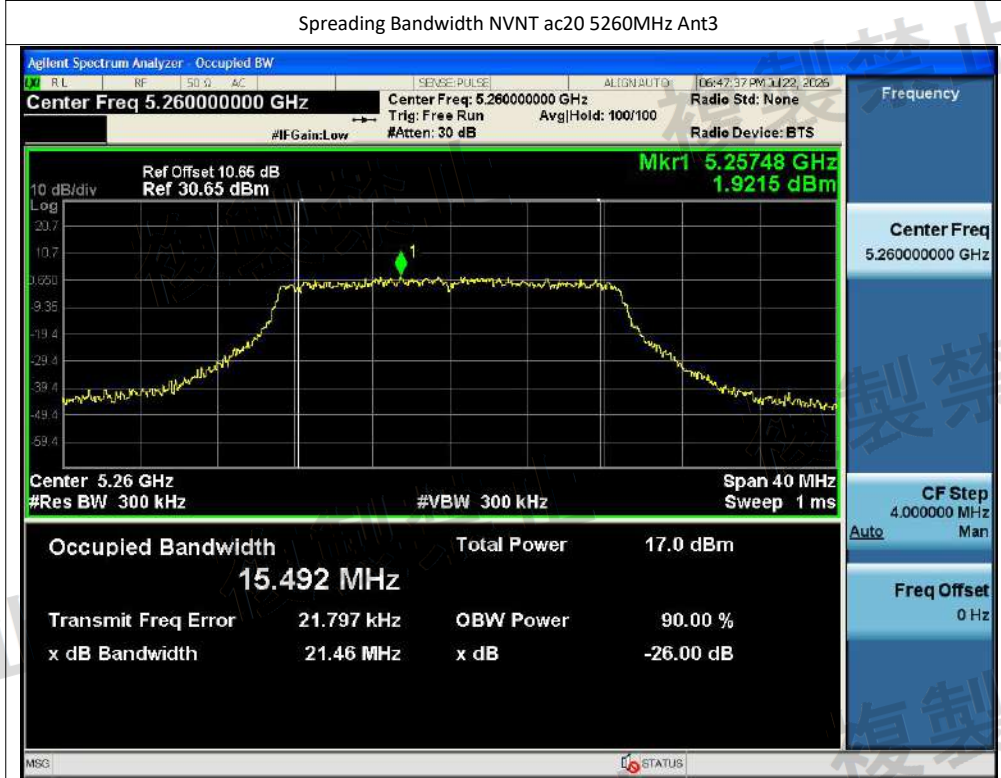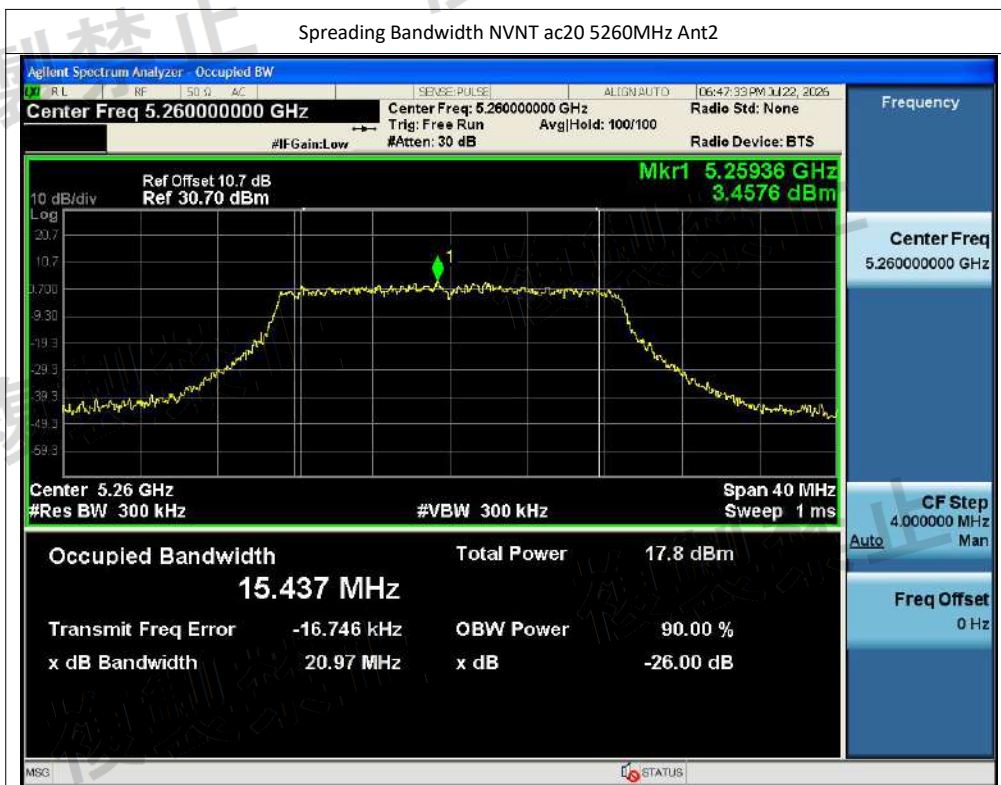


Spreading Bandwidth NVNT ac20 5300MHz Ant1



Spreading Bandwidth NVNT ac20 5300MHz Ant2



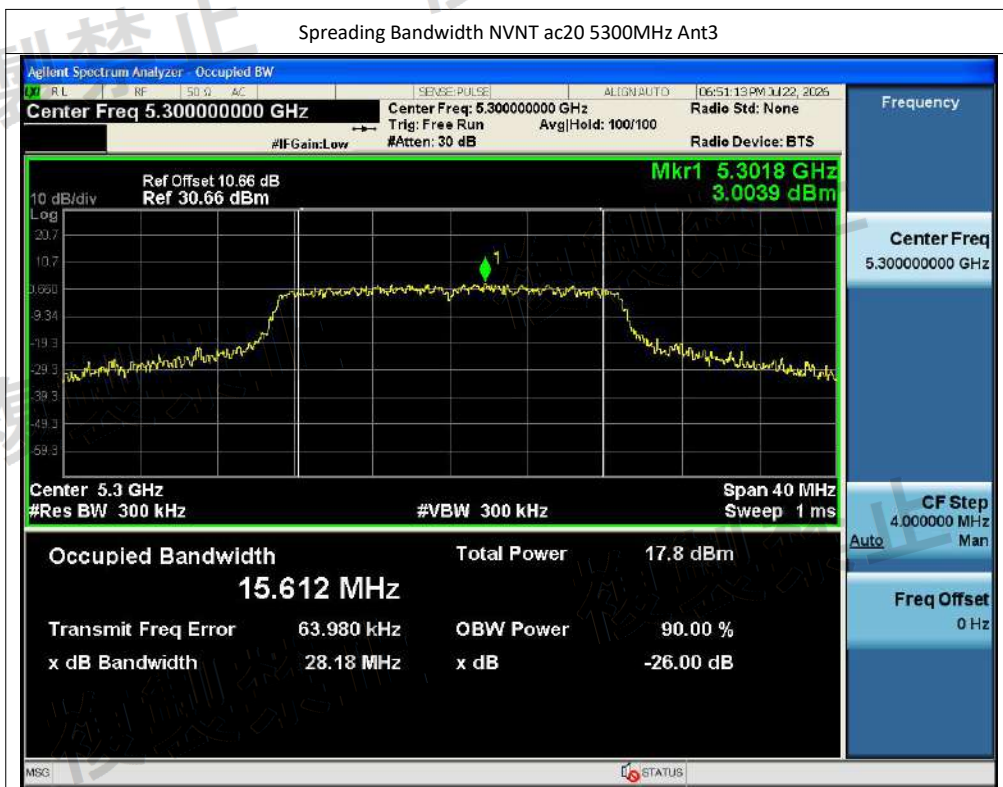


Spreading Bandwidth NVNT ac20 5320MHz Ant2



Spreading Bandwidth NVNT ac20 5320MHz Ant3




Spreading Bandwidth NVNT ac40 5270MHz Ant1

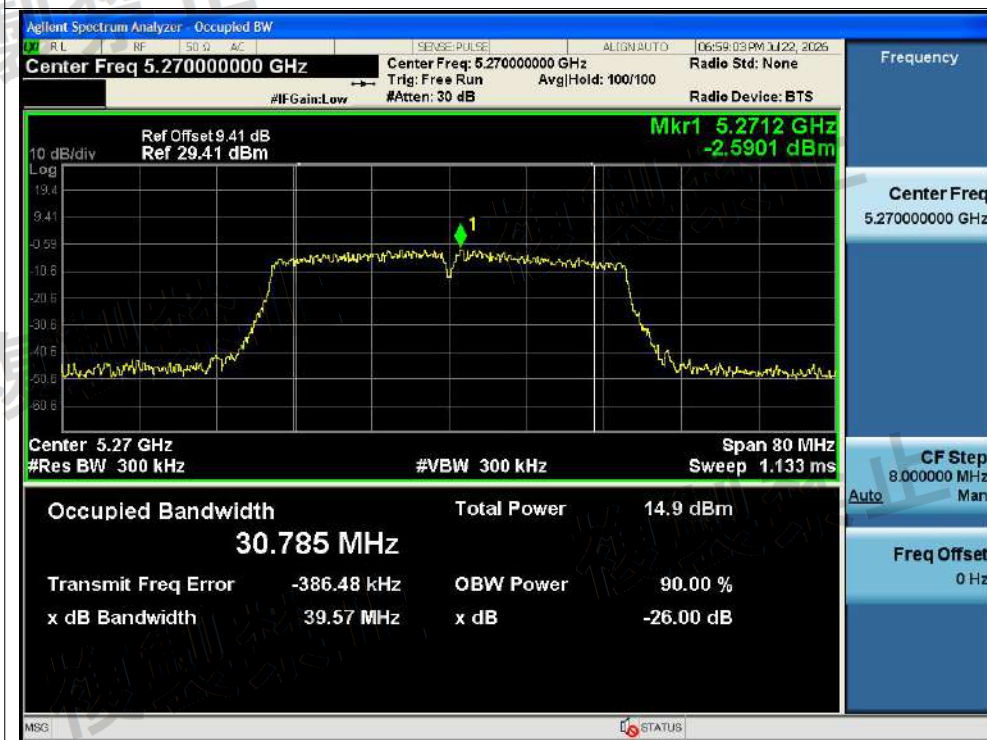

Spreading Bandwidth NVNT ac40 5270MHz Ant2



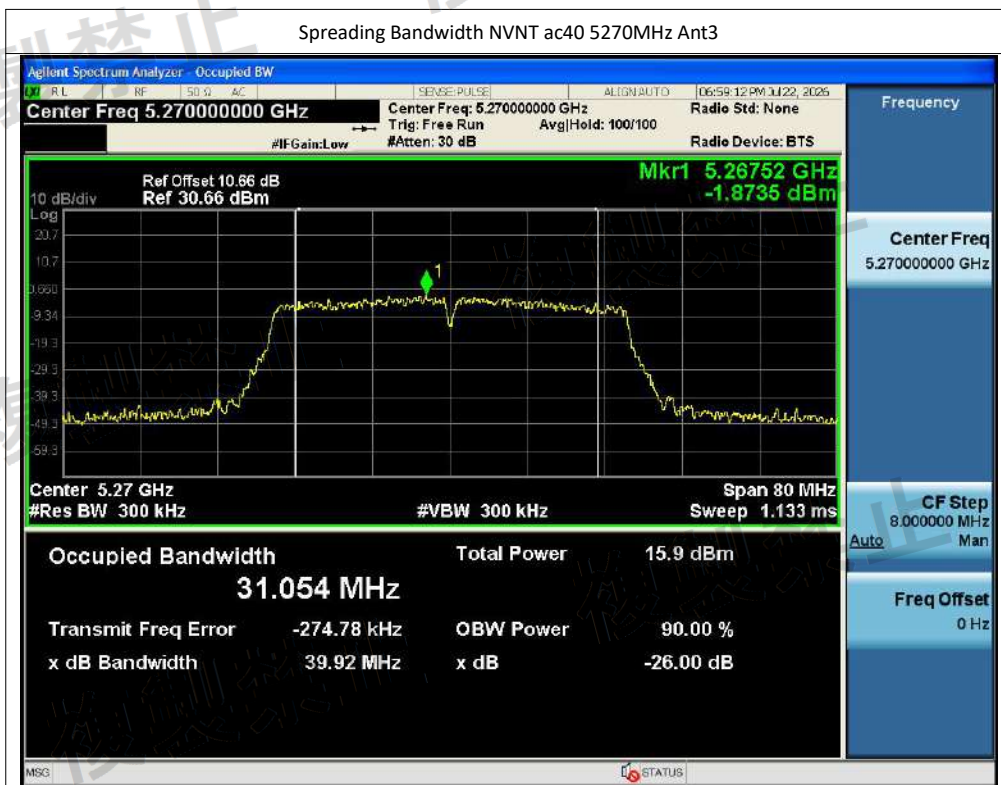

Spreading Bandwidth NVNT ac40 5310MHz Ant2



Spreading Bandwidth NVNT ac40 5310MHz Ant3



Spreading Bandwidth NVNT ac80 5290MHz Ant1



Spreading Bandwidth NVNT ac80 5290MHz Ant2





Spreading Bandwidth NVNT ax20 5260MHz Ant2



Spreading Bandwidth NVNT ax20 5260MHz Ant3



Spreading Bandwidth NVNT ax20 5300MHz Ant1



Spreading Bandwidth NVNT ax20 5300MHz Ant2



Spreading Bandwidth NVNT ax20 5300MHz Ant3



Spreading Bandwidth NVNT ax20 5320MHz Ant1



Spreading Bandwidth NVNT ax20 5320MHz Ant2



Spreading Bandwidth NVNT ax20 5320MHz Ant3




Spreading Bandwidth NVNT ax40 5270MHz Ant1



Spreading Bandwidth NVNT ax40 5270MHz Ant2



Spreading Bandwidth NVNT ax40 5270MHz Ant3

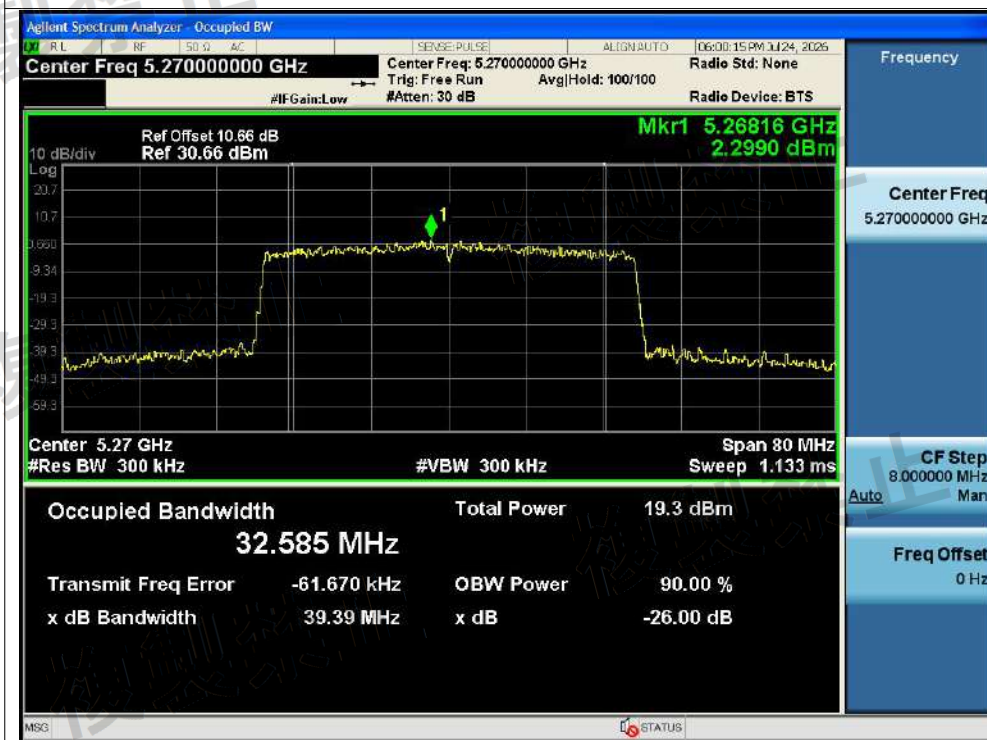

Spreading Bandwidth NVNT ax40 5310MHz Ant1



Spreading Bandwidth NVNT ax40 5310MHz Ant2



Spreading Bandwidth NVNT ax40 5310MHz Ant3



Spreading Bandwidth NVNT ax80 5290MHz Ant1



Spreading Bandwidth NVNT ax80 5290MHz Ant2






Spreading Bandwidth NVNT ax80 5290MHz Ant3




Spreading Bandwidth NVNT n20 5260MHz Ant1



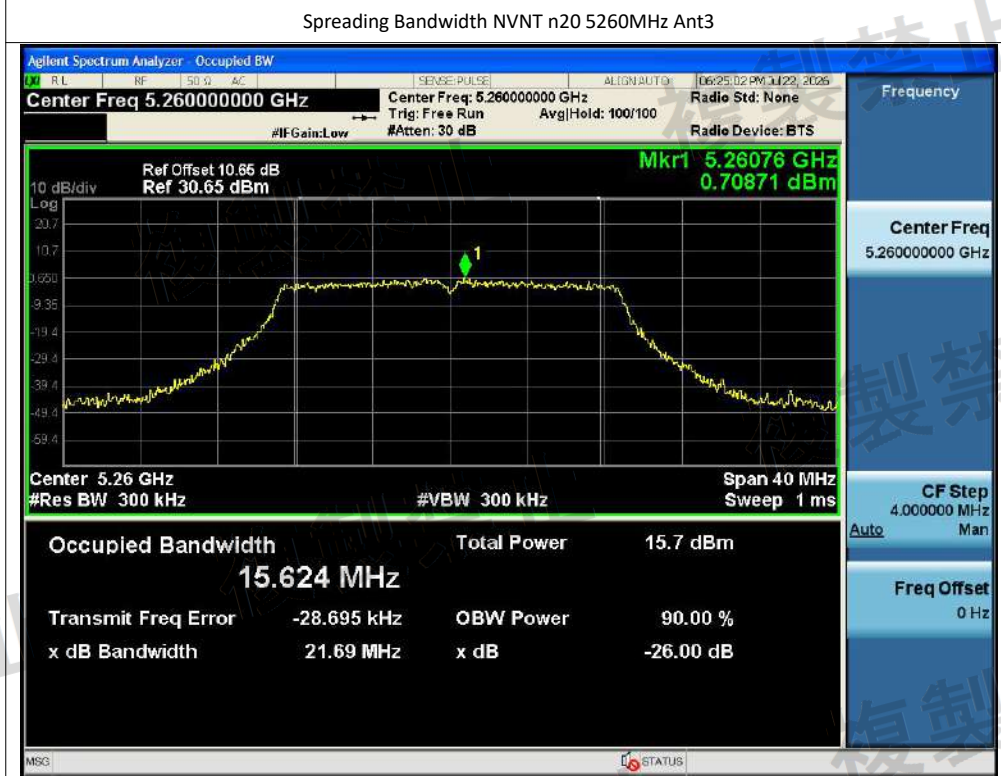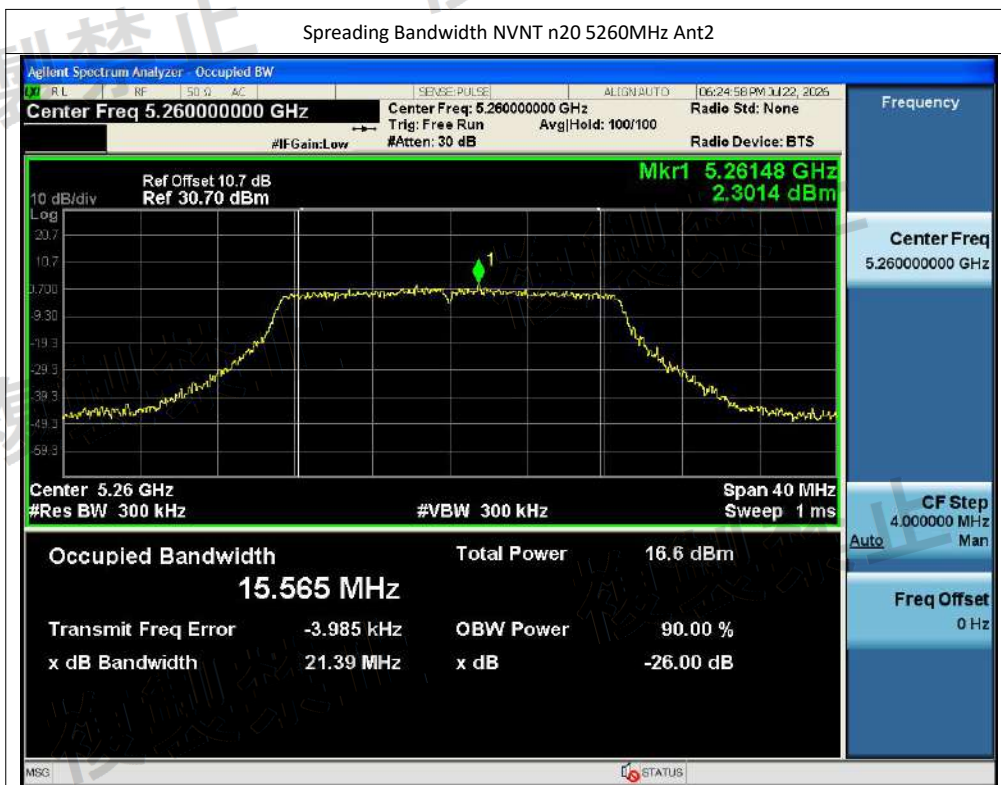

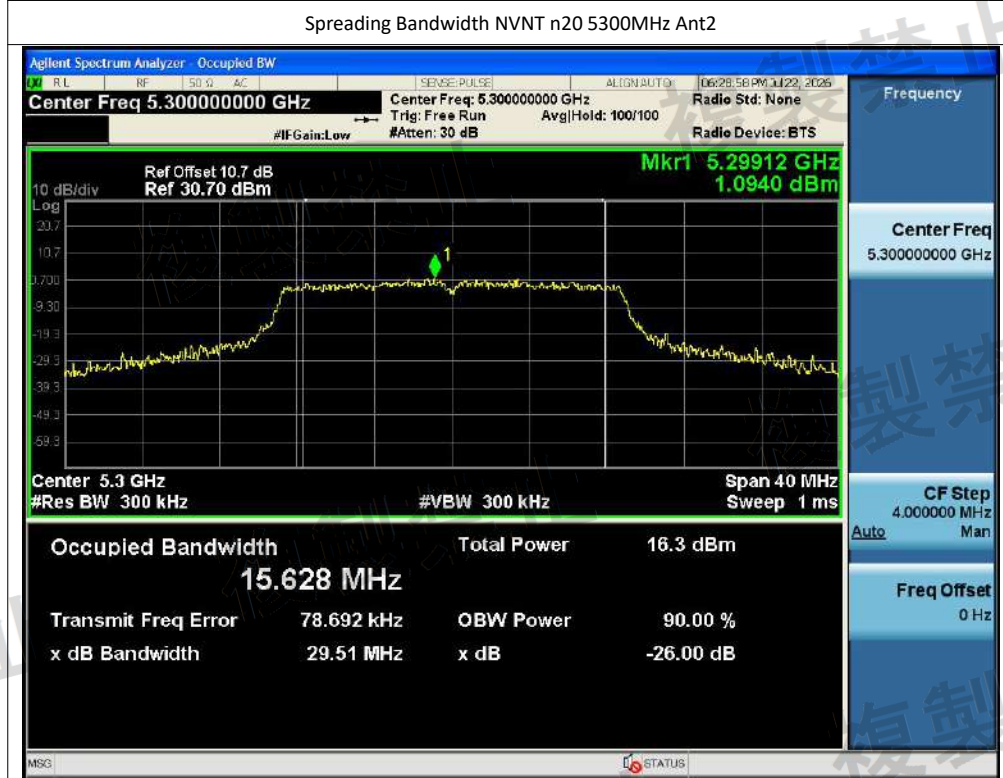

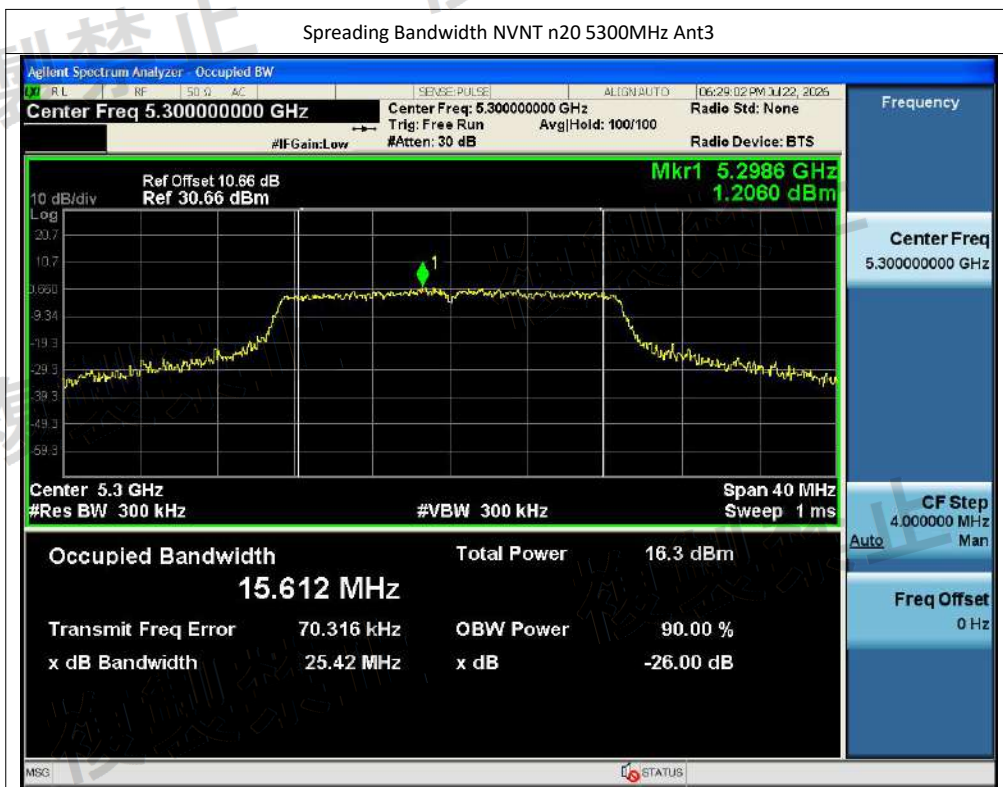









Tx Spurious Emission

Condition	Mode	Frequency (MHz)	Antenna	Range (MHz)	Emission Frequency (MHz)	Max Peak Value (dBm)	Max RMS Value (dBm)	Max Peak Value (uW)	Max RMS Value (uW)	Limit Start(uW)	Limit Stop (uW)	Verdict
NVNT	a	5260	Ant1	30-5233.3	5233.30	-38.71	NA	0.1346	NA	2.5	2.5	Pass
NVNT	a	5260	Ant1	5233.3-5240	5236.37	-30.78	NA	0.8356	NA	2.49	15.85	Pass
NVNT	a	5260	Ant1	5240-5249	5249.00	-14.98	NA	31.7687	NA	15.85	100	Pass
NVNT	a	5260	Ant1	5249-5250	5249.06	-13.66	NA	43.0527	NA	100	1000	Pass
NVNT	a	5260	Ant1	5350-26000	25215.30	-39.15	NA	0.1216	NA	2.5	2.5	Pass
NVNT	a	5300	Ant1	30-5233.3	3271.66	-47.09	NA	0.0195	NA	2.5	2.5	Pass
NVNT	a	5300	Ant1	5233.3-5240	5233.67	-48.84	NA	0.0131	NA	2.49	15.85	Pass
NVNT	a	5300	Ant1	5240-5249	5240.13	-47.41	NA	0.0182	NA	15.85	100	Pass
NVNT	a	5300	Ant1	5249-5250	5249.04	-47.84	NA	0.0164	NA	100	1000	Pass
NVNT	a	5300	Ant1	5350-26000	25814.15	-38.86	NA	0.13	NA	2.5	2.5	Pass
NVNT	a	5320	Ant1	30-5233.3	2548.40	-38.14	NA	0.1535	NA	2.5	2.5	Pass
NVNT	a	5320	Ant1	5233.3-5240	5233.38	-49.59	NA	0.011	NA	2.49	15.85	Pass
NVNT	a	5320	Ant1	5240-5249	5240.01	-48.50	NA	0.0141	NA	15.85	100	Pass
NVNT	a	5320	Ant1	5249-5250	5249.02	-48.32	NA	0.0147	NA	100	1000	Pass
NVNT	a	5320	Ant1	5350-26000	5350.00	-32.12	NA	0.6138	NA	2.5	2.5	Pass
NVNT	a	5260	Ant2	30-5233.3	5233.30	-38.55	NA	0.1396	NA	2.5	2.5	Pass
NVNT	a	5260	Ant2	5233.3-5240	5234.11	-31.89	NA	0.6471	NA	2.49	15.85	Pass
NVNT	a	5260	Ant2	5240-5249	5248.33	-13.41	NA	45.6037	NA	15.85	100	Pass
NVNT	a	5260	Ant2	5249-5250	5249.08	-10.06	NA	98.6279	NA	100	1000	Pass
NVNT	a	5260	Ant2	5350-26000	25070.75	-36.78	NA	0.2099	NA	2.5	2.5	Pass
NVNT	a	5300	Ant2	30-5233.3	2605.63	-45.84	NA	0.0261	NA	2.5	2.5	Pass
NVNT	a	5300	Ant2	5233.3-5240	5233.50	-46.68	NA	0.0215	NA	2.49	15.85	Pass
NVNT	a	5300	Ant2	5240-5249	5240.15	-47.30	NA	0.0186	NA	15.85	100	Pass
NVNT	a	5300	Ant2	5249-5250	5249.06	-45.93	NA	0.0255	NA	100	1000	Pass
NVNT	a	5300	Ant2	5350-26000	24657.75	-37.18	NA	0.1914	NA	2.5	2.5	Pass
NVNT	a	5320	Ant2	30-5233.3	2553.60	-41.53	NA	0.0703	NA	2.5	2.5	Pass
NVNT	a	5320	Ant2	5233.3-5240	5234.10	-45.99	NA	0.0252	NA	2.49	15.85	Pass
NVNT	a	5320	Ant2	5240-5249	5240.23	-47.36	NA	0.0184	NA	15.85	100	Pass
NVNT	a	5320	Ant2	5249-5250	5249.07	-47.60	NA	0.0174	NA	100	1000	Pass
NVNT	a	5320	Ant2	5350-26000	5350.00	-31.57	NA	0.6966	NA	2.5	2.5	Pass
NVNT	a	5260	Ant3	30-5233.3	5233.30	-40.90	NA	0.0813	NA	2.5	2.5	Pass
NVNT	a	5260	Ant3	5233.3-5240	5234.65	-34.58	NA	0.3483	NA	2.49	15.85	Pass
NVNT	a	5260	Ant3	5240-5249	5248.95	-12.21	NA	60.1174	NA	15.85	100	Pass
NVNT	a	5260	Ant3	5249-5250	5249.01	-13.12	NA	48.7528	NA	100	1000	Pass
NVNT	a	5260	Ant3	5350-26000	25339.20	-37.48	NA	0.1786	NA	2.5	2.5	Pass
NVNT	a	5300	Ant3	30-5233.3	2558.80	-40.07	NA	0.0984	NA	2.5	2.5	Pass

NVNT	a	5300	Ant3	5233.3-5240	5233.84	-48.62	NA	0.0137	NA	2.49	15.85	Pass
NVNT	a	5300	Ant3	5240-5249	5241.44	-46.40	NA	0.0229	NA	15.85	100	Pass
NVNT	a	5300	Ant3	5249-5250	5249.01	-48.05	NA	0.0157	NA	100	1000	Pass
NVNT	a	5300	Ant3	5350-26000	25297.90	-37.34	NA	0.1845	NA	2.5	2.5	Pass
NVNT	a	5320	Ant3	30-5233.3	2548.40	-45.48	NA	0.0283	NA	2.5	2.5	Pass
NVNT	a	5320	Ant3	5233.3-5240	5233.33	-47.82	NA	0.0165	NA	2.49	15.85	Pass
NVNT	a	5320	Ant3	5240-5249	5240.07	-48.75	NA	0.0133	NA	15.85	100	Pass
NVNT	a	5320	Ant3	5249-5250	5249.00	-48.36	NA	0.0146	NA	100	1000	Pass
NVNT	a	5320	Ant3	5350-26000	5350.00	-31.86	NA	0.6516	NA	2.5	2.5	Pass
NVNT	ac20	5260	Ant1	30-5233.3	5233.30	-39.72	NA	0.1067	NA	2.5	2.5	Pass
NVNT	ac20	5260	Ant1	5233.3-5240	5233.37	-40.61	NA	0.0869	NA	2.49	15.85	Pass
NVNT	ac20	5260	Ant1	5240-5249	5248.97	-15.43	NA	28.6418	NA	15.85	100	Pass
NVNT	ac20	5260	Ant1	5249-5250	5249.03	-14.08	NA	39.0841	NA	100	1000	Pass
NVNT	ac20	5260	Ant1	5350-26000	25359.85	-39.06	NA	0.1242	NA	2.5	2.5	Pass
NVNT	ac20	5260	Ant2	30-5233.3	5233.30	-39.49	NA	0.1125	NA	2.5	2.5	Pass
NVNT	ac20	5260	Ant2	5233.3-5240	5235.79	-35.01	NA	0.3155	NA	2.49	15.85	Pass
NVNT	ac20	5260	Ant2	5240-5249	5248.96	-12.11	NA	61.5177	NA	15.85	100	Pass
NVNT	ac20	5260	Ant2	5249-5250	5249.09	-10.47	NA	89.7429	NA	100	1000	Pass
NVNT	ac20	5260	Ant2	5350-26000	24678.40	-37.09	NA	0.1954	NA	2.5	2.5	Pass
NVNT	ac20	5260	Ant3	30-5233.3	5233.30	-40.11	NA	0.0975	NA	2.5	2.5	Pass
NVNT	ac20	5260	Ant3	5233.3-5240	5237.81	-33.72	NA	0.4246	NA	2.49	15.85	Pass
NVNT	ac20	5260	Ant3	5240-5249	5248.93	-13.98	NA	39.9945	NA	15.85	100	Pass
NVNT	ac20	5260	Ant3	5249-5250	5249.04	-13.32	NA	46.5586	NA	100	1000	Pass
NVNT	ac20	5260	Ant3	5350-26000	25297.90	-36.54	NA	0.2218	NA	2.5	2.5	Pass
NVNT	ac20	5300	Ant1	30-5233.3	2662.87	-47.07	NA	0.0196	NA	2.5	2.5	Pass
NVNT	ac20	5300	Ant1	5233.3-5240	5234.17	-48.65	NA	0.0136	NA	2.49	15.85	Pass
NVNT	ac20	5300	Ant1	5240-5249	5241.04	-47.70	NA	0.017	NA	15.85	100	Pass
NVNT	ac20	5300	Ant1	5249-5250	5249.02	-48.58	NA	0.0139	NA	100	1000	Pass
NVNT	ac20	5300	Ant1	5350-26000	25297.90	-38.55	NA	0.1396	NA	2.5	2.5	Pass
NVNT	ac20	5300	Ant2	30-5233.3	5155.25	-45.56	NA	0.0278	NA	2.5	2.5	Pass
NVNT	ac20	5300	Ant2	5233.3-5240	5233.55	-48.20	NA	0.0151	NA	2.49	15.85	Pass
NVNT	ac20	5300	Ant2	5240-5249	5241.09	-46.44	NA	0.0227	NA	15.85	100	Pass
NVNT	ac20	5300	Ant2	5249-5250	5249.07	-47.18	NA	0.0191	NA	100	1000	Pass
NVNT	ac20	5300	Ant2	5350-26000	24678.40	-36.54	NA	0.2218	NA	2.5	2.5	Pass
NVNT	ac20	5300	Ant3	30-5233.3	5233.30	-46.36	NA	0.0231	NA	2.5	2.5	Pass
NVNT	ac20	5300	Ant3	5233.3-5240	5233.70	-47.59	NA	0.0174	NA	2.49	15.85	Pass
NVNT	ac20	5300	Ant3	5240-5249	5240.06	-48.21	NA	0.0151	NA	15.85	100	Pass
NVNT	ac20	5300	Ant3	5249-5250	5249.01	-47.45	NA	0.018	NA	100	1000	Pass
NVNT	ac20	5300	Ant3	5350-26000	25339.20	-37.47	NA	0.1791	NA	2.5	2.5	Pass
NVNT	ac20	5320	Ant1	30-5233.3	3302.88	-47.05	NA	0.0197	NA	2.5	2.5	Pass
NVNT	ac20	5320	Ant1	5233.3-5240	5233.31	-49.65	NA	0.0108	NA	2.49	15.85	Pass
NVNT	ac20	5320	Ant1	5240-5249	5240.04	-48.03	NA	0.0157	NA	15.85	100	Pass

NVNT	ac20	5320	Ant1	5249-5250	5249.01	-48.32	NA	0.0147	NA	100	1000	Pass
NVNT	ac20	5320	Ant1	5350-26000	5350.00	-32.98	NA	0.5035	NA	2.5	2.5	Pass
NVNT	ac20	5320	Ant2	30-5233.3	5035.57	-46.47	NA	0.0225	NA	2.5	2.5	Pass
NVNT	ac20	5320	Ant2	5233.3-5240	5233.72	-47.70	NA	0.017	NA	2.49	15.85	Pass
NVNT	ac20	5320	Ant2	5240-5249	5240.47	-46.69	NA	0.0214	NA	15.85	100	Pass
NVNT	ac20	5320	Ant2	5249-5250	5249.05	-47.73	NA	0.0169	NA	100	1000	Pass
NVNT	ac20	5320	Ant2	5350-26000	5350.00	-28.47	NA	1.4223	NA	2.5	2.5	Pass
NVNT	ac20	5320	Ant3	30-5233.3	3151.98	-46.66	NA	0.0216	NA	2.5	2.5	Pass
NVNT	ac20	5320	Ant3	5233.3-5240	5233.51	-48.35	NA	0.0146	NA	2.49	15.85	Pass
NVNT	ac20	5320	Ant3	5240-5249	5240.02	-47.90	NA	0.0162	NA	15.85	100	Pass
NVNT	ac20	5320	Ant3	5249-5250	5249.06	-47.95	NA	0.016	NA	100	1000	Pass
NVNT	ac20	5320	Ant3	5350-26000	5350.00	-28.30	NA	1.4791	NA	2.5	2.5	Pass
NVNT	ac40	5270	Ant1	30-5221.6	3196.88	-48.14	NA	0.0153	NA	2.5	2.5	Pass
NVNT	ac40	5270	Ant1	5221.6-5230	5221.93	-44.80	NA	0.0331	NA	2.48	7.92	Pass
NVNT	ac40	5270	Ant1	5230-5249	5248.94	-25.41	NA	2.8774	NA	7.92	50	Pass
NVNT	ac40	5270	Ant1	5249-5250	5249.12	-22.29	NA	5.902	NA	50	500	Pass
NVNT	ac40	5270	Ant1	5350-5358.4	5355.12	-50.44	NA	0.009	NA	15	15	Pass
NVNT	ac40	5270	Ant1	5358.4-26000	24658.30	-38.29	NA	0.1483	NA	2.5	2.5	Pass
NVNT	ac40	5270	Ant2	30-5221.6	3035.94	-45.69	NA	0.027	NA	2.5	2.5	Pass
NVNT	ac40	5270	Ant2	5221.6-5230	5225.48	-41.64	NA	0.0685	NA	2.48	7.92	Pass
NVNT	ac40	5270	Ant2	5230-5249	5248.98	-24.09	NA	3.8994	NA	7.92	50	Pass
NVNT	ac40	5270	Ant2	5249-5250	5249.02	-20.67	NA	8.5704	NA	50	500	Pass
NVNT	ac40	5270	Ant2	5350-5358.4	5355.82	-48.00	NA	0.0158	NA	15	15	Pass
NVNT	ac40	5270	Ant2	5358.4-26000	24678.94	-37.08	NA	0.1959	NA	2.5	2.5	Pass
NVNT	ac40	5270	Ant3	30-5221.6	5221.60	-45.92	NA	0.0256	NA	2.5	2.5	Pass
NVNT	ac40	5270	Ant3	5221.6-5230	5225.34	-42.37	NA	0.0579	NA	2.48	7.92	Pass
NVNT	ac40	5270	Ant3	5230-5249	5248.87	-23.22	NA	4.7643	NA	7.92	50	Pass
NVNT	ac40	5270	Ant3	5249-5250	5249.11	-21.65	NA	6.8391	NA	50	500	Pass
NVNT	ac40	5270	Ant3	5350-5358.4	5351.13	-48.66	NA	0.0136	NA	15	15	Pass
NVNT	ac40	5270	Ant3	5358.4-26000	25277.54	-37.86	NA	0.1637	NA	2.5	2.5	Pass
NVNT	ac40	5310	Ant1	30-5221.6	3414.92	-45.01	NA	0.0316	NA	2.5	2.5	Pass
NVNT	ac40	5310	Ant1	5221.6-5230	5224.43	-46.32	NA	0.0233	NA	2.48	7.92	Pass
NVNT	ac40	5310	Ant1	5230-5249	5233.95	-46.84	NA	0.0207	NA	7.92	50	Pass
NVNT	ac40	5310	Ant1	5249-5250	5249.31	-41.91	NA	0.0644	NA	50	500	Pass
NVNT	ac40	5310	Ant1	5350-5358.4	5351.83	-45.14	NA	0.0306	NA	15	15	Pass
NVNT	ac40	5310	Ant1	5358.4-26000	24699.58	-36.99	NA	0.2	NA	2.5	2.5	Pass
NVNT	ac40	5310	Ant2	30-5221.6	2688.10	-40.79	NA	0.0834	NA	2.5	2.5	Pass
NVNT	ac40	5310	Ant2	5221.6-5230	5221.73	-43.38	NA	0.0459	NA	2.48	7.92	Pass
NVNT	ac40	5310	Ant2	5230-5249	5230.13	-42.92	NA	0.0511	NA	7.92	50	Pass
NVNT	ac40	5310	Ant2	5249-5250	5249.15	-39.10	NA	0.123	NA	50	500	Pass
NVNT	ac40	5310	Ant2	5350-5358.4	5350.18	-38.50	NA	0.1413	NA	15	15	Pass
NVNT	ac40	5310	Ant2	5358.4-26000	25339.47	-31.43	NA	0.7194	NA	2.5	2.5	Pass

NVNT	ac40	5310	Ant3	30-5221.6	3144.96	-46.40	NA	0.0229	NA	2.5	2.5	Pass
NVNT	ac40	5310	Ant3	5221.6-5230	5222.35	-49.14	NA	0.0122	NA	2.48	7.92	Pass
NVNT	ac40	5310	Ant3	5230-5249	5230.49	-48.79	NA	0.0132	NA	7.92	50	Pass
NVNT	ac40	5310	Ant3	5249-5250	5249.01	-47.99	NA	0.0159	NA	50	500	Pass
NVNT	ac40	5310	Ant3	5350-5358.4	5350.09	-45.53	NA	0.028	NA	15	15	Pass
NVNT	ac40	5310	Ant3	5358.4-26000	24658.30	-36.93	NA	0.2028	NA	2.5	2.5	Pass
NVNT	ac80	5290	Ant1	30-5203.3	5203.30	-30.02	NA	0.9954	NA	2.5	2.5	Pass
NVNT	ac80	5290	Ant1	5203.3-5290	5208.62	-28.13	NA	1.5382	NA	2.49	3.96	Pass
NVNT	ac80	5290	Ant1	5290-5249	5234.96	-19.10	NA	12.3027	NA	3.96	25	Pass
NVNT	ac80	5290	Ant1	5249-5250	5249.12	-16.71	NA	21.3304	NA	25	250	Pass
NVNT	ac80	5290	Ant1	5350-5376.8	5354.02	-38.80	NA	0.1318	NA	15	15	Pass
NVNT	ac80	5290	Ant1	5376.8-26000	25319.43	-36.54	NA	0.2218	NA	2.5	2.5	Pass
NVNT	ac80	5290	Ant2	30-5203.3	5198.13	-26.29	NA	2.3496	NA	2.5	2.5	Pass
NVNT	ac80	5290	Ant2	5203.3-5290	5206.98	-23.34	-37.15	4.6345	0.1928	2.49	3.96	Pass
NVNT	ac80	5290	Ant2	5290-5249	5228.68	-16.04	-32.1	24.8886	0.6166	3.96	25	Pass
NVNT	ac80	5290	Ant2	5249-5250	5249.02	-11.45	-26.05	71.6143	2.4831	25	250	Pass
NVNT	ac80	5290	Ant2	5350-5376.8	5350.00	-33.90	NA	0.4074	NA	15	15	Pass
NVNT	ac80	5290	Ant2	5376.8-26000	24618.25	-31.70	NA	0.6761	NA	2.5	2.5	Pass
NVNT	ac80	5290	Ant3	30-5203.3	5198.13	-32.82	NA	0.5224	NA	2.5	2.5	Pass
NVNT	ac80	5290	Ant3	5203.3-5290	5208.14	-28.76	NA	1.3305	NA	2.49	3.96	Pass
NVNT	ac80	5290	Ant3	5290-5249	5235.08	-19.73	NA	10.6414	NA	3.96	25	Pass
NVNT	ac80	5290	Ant3	5249-5250	5249.10	-19.04	NA	12.4738	NA	25	250	Pass
NVNT	ac80	5290	Ant3	5350-5376.8	5351.23	-39.66	NA	0.1081	NA	15	15	Pass
NVNT	ac80	5290	Ant3	5376.8-26000	25319.43	-37.33	NA	0.1849	NA	2.5	2.5	Pass
NVNT	ax20	5260	Ant1	30-5233.3	5233.30	-38.26	NA	0.1493	NA	2.5	2.5	Pass
NVNT	ax20	5260	Ant1	5233.3-5240	5239.42	-25.40	NA	2.884	NA	2.49	15.85	Pass
NVNT	ax20	5260	Ant1	5240-5249	5248.99	-9.25	-28.91	118.8502	1.2853	15.85	100	Pass
NVNT	ax20	5260	Ant1	5249-5249.8	5249.40	-4.59	-21.52	347.5362	7.0469	100	630.96	Pass
NVNT	ax20	5260	Ant1	5249.8-5250	5249.80	-1.30	-13.63	741.3102	43.3511	630.96	2154.43	Pass
NVNT	ax20	5260	Ant1	5350-26000	25091.40	-38.98	NA	0.1265	NA	2.5	2.5	Pass
NVNT	ax20	5260	Ant2	30-5233.3	5233.30	-35.56	NA	0.278	NA	2.5	2.5	Pass
NVNT	ax20	5260	Ant2	5233.3-5240	5237.73	-23.40	NA	4.5709	NA	2.49	15.85	Pass
NVNT	ax20	5260	Ant2	5240-5249	5248.81	-8.17	-28.75	152.4053	1.3335	15.85	100	Pass
NVNT	ax20	5260	Ant2	5249-5249.8	5249.42	-2.00	-19.63	630.9573	10.8893	100	630.96	Pass
NVNT	ax20	5260	Ant2	5249.8-5250	5249.82	2.17	-10.57	1648.1624	87.7001	630.96	2154.43	Pass
NVNT	ax20	5260	Ant2	5350-26000	24657.75	-37.01	NA	0.1991	NA	2.5	2.5	Pass
NVNT	ax20	5260	Ant3	30-5233.3	5233.30	-37.98	NA	0.1592	NA	2.5	2.5	Pass
NVNT	ax20	5260	Ant3	5233.3-5240	5237.80	-24.71	NA	3.3806	NA	2.49	15.85	Pass
NVNT	ax20	5260	Ant3	5240-5249	5248.81	-9.74	-30.14	106.1696	0.9683	15.85	100	Pass
NVNT	ax20	5260	Ant3	5249-5249.8	5249.41	-3.07	-20.68	493.1738	8.5507	100	630.96	Pass
NVNT	ax20	5260	Ant3	5249.8-5250	5249.82	0.20	-11.67	1047.1285	68.0769	630.96	2154.43	Pass
NVNT	ax20	5260	Ant3	5350-26000	25318.55	-37.47	NA	0.1791	NA	2.5	2.5	Pass

NVNT	ax20	5300	Ant1	30-5233.3	5233.30	-47.77	NA	0.0167	NA	2.5	2.5	Pass
NVNT	ax20	5300	Ant1	5233.3-5240	5233.59	-49.55	NA	0.0111	NA	2.49	15.85	Pass
NVNT	ax20	5300	Ant1	5240-5249	5240.25	-48.16	NA	0.0153	NA	15.85	100	Pass
NVNT	ax20	5300	Ant1	5249-5249.8	5249.05	-48.78	NA	0.0132	NA	100	630.96	Pass
NVNT	ax20	5300	Ant1	5249.8-5250	5249.80	-49.03	NA	0.0125	NA	630.96	2154.43	Pass
NVNT	ax20	5300	Ant1	5350-26000	24761.00	-37.99	NA	0.1589	NA	2.5	2.5	Pass
NVNT	ax20	5300	Ant2	30-5233.3	5217.69	-46.12	NA	0.0244	NA	2.5	2.5	Pass
NVNT	ax20	5300	Ant2	5233.3-5240	5233.31	-48.67	NA	0.0136	NA	2.49	15.85	Pass
NVNT	ax20	5300	Ant2	5240-5249	5240.28	-47.70	NA	0.017	NA	15.85	100	Pass
NVNT	ax20	5300	Ant2	5249-5249.8	5249.14	-45.35	NA	0.0292	NA	100	630.96	Pass
NVNT	ax20	5300	Ant2	5249.8-5250	5249.82	-45.94	NA	0.0255	NA	630.96	2154.43	Pass
NVNT	ax20	5300	Ant2	5350-26000	24678.40	-37.24	NA	0.1888	NA	2.5	2.5	Pass
NVNT	ax20	5300	Ant3	30-5233.3	5233.30	-45.70	NA	0.0269	NA	2.5	2.5	Pass
NVNT	ax20	5300	Ant3	5233.3-5240	5233.82	-48.80	NA	0.0132	NA	2.49	15.85	Pass
NVNT	ax20	5300	Ant3	5240-5249	5240.02	-48.22	NA	0.0151	NA	15.85	100	Pass
NVNT	ax20	5300	Ant3	5249-5249.8	5249.04	-47.96	NA	0.016	NA	100	630.96	Pass
NVNT	ax20	5300	Ant3	5249.8-5250	5249.80	-47.73	NA	0.0169	NA	630.96	2154.43	Pass
NVNT	ax20	5300	Ant3	5350-26000	25297.90	-37.54	NA	0.1762	NA	2.5	2.5	Pass
NVNT	ax20	5320	Ant1	30-5233.3	3146.78	-47.14	NA	0.0193	NA	2.5	2.5	Pass
NVNT	ax20	5320	Ant1	5233.3-5240	5233.57	-49.77	NA	0.0105	NA	2.49	15.85	Pass
NVNT	ax20	5320	Ant1	5240-5249	5240.07	-49.55	NA	0.0111	NA	15.85	100	Pass
NVNT	ax20	5320	Ant1	5249-5249.8	5249.01	-46.99	NA	0.02	NA	100	630.96	Pass
NVNT	ax20	5320	Ant1	5249.8-5250	5249.82	-48.70	NA	0.0135	NA	630.96	2154.43	Pass
NVNT	ax20	5320	Ant1	5350-26000	5350.00	-29.11	NA	1.2274	NA	2.5	2.5	Pass
NVNT	ax20	5320	Ant2	30-5233.3	5233.30	-46.05	NA	0.0248	NA	2.5	2.5	Pass
NVNT	ax20	5320	Ant2	5233.3-5240	5234.30	-46.80	NA	0.0209	NA	2.49	15.85	Pass
NVNT	ax20	5320	Ant2	5240-5249	5240.26	-47.21	NA	0.019	NA	15.85	100	Pass
NVNT	ax20	5320	Ant2	5249-5249.8	5249.01	-47.58	NA	0.0175	NA	100	630.96	Pass
NVNT	ax20	5320	Ant2	5249.8-5250	5249.80	-47.56	NA	0.0175	NA	630.96	2154.43	Pass
NVNT	ax20	5320	Ant2	5350-26000	5350.00	-27.73	NA	1.6866	NA	2.5	2.5	Pass
NVNT	ax20	5320	Ant3	30-5233.3	2761.73	-46.82	NA	0.0208	NA	2.5	2.5	Pass
NVNT	ax20	5320	Ant3	5233.3-5240	5233.47	-47.57	NA	0.0175	NA	2.49	15.85	Pass
NVNT	ax20	5320	Ant3	5240-5249	5240.00	-47.30	NA	0.0186	NA	15.85	100	Pass
NVNT	ax20	5320	Ant3	5249-5249.8	5249.14	-47.01	NA	0.0199	NA	100	630.96	Pass
NVNT	ax20	5320	Ant3	5249.8-5250	5249.80	-47.89	NA	0.0163	NA	630.96	2154.43	Pass
NVNT	ax20	5320	Ant3	5350-26000	5350.00	-28.12	NA	1.5417	NA	2.5	2.5	Pass
NVNT	ax40	5270	Ant1	30-5221.6	5221.60	-43.34	NA	0.0463	NA	2.5	2.5	Pass
NVNT	ax40	5270	Ant1	5221.6-5230	5224.36	-36.36	NA	0.2312	NA	2.48	7.92	Pass
NVNT	ax40	5270	Ant1	5230-5249	5234.60	-31.55	NA	0.6998	NA	7.92	50	Pass
NVNT	ax40	5270	Ant1	5249-5250	5250.00	-12.28	NA	59.1562	NA	50	500	Pass
NVNT	ax40	5270	Ant1	5350-5358.4	5354.36	-46.81	NA	0.0208	NA	15	15	Pass
NVNT	ax40	5270	Ant1	5358.4-26000	24658.30	-39.01	NA	0.1256	NA	2.5	2.5	Pass

NVNT	ax40	5270	Ant2	30-5221.6	5221.60	-41.27	NA	0.0746	NA	2.5	2.5	Pass
NVNT	ax40	5270	Ant2	5221.6-5230	5227.46	-32.32	NA	0.5861	NA	2.48	7.92	Pass
NVNT	ax40	5270	Ant2	5230-5249	5234.94	-30.10	NA	0.9772	NA	7.92	50	Pass
NVNT	ax40	5270	Ant2	5249-5250	5249.07	-19.00	NA	12.5893	NA	50	500	Pass
NVNT	ax40	5270	Ant2	5350-5358.4	5352.07	-43.93	NA	0.0405	NA	15	15	Pass
NVNT	ax40	5270	Ant2	5358.4-26000	24678.94	-36.06	NA	0.2477	NA	2.5	2.5	Pass
NVNT	ax40	5270	Ant3	30-5221.6	2480.44	-40.32	NA	0.0929	NA	2.5	2.5	Pass
NVNT	ax40	5270	Ant3	5221.6-5230	5222.65	-38.40	NA	0.1445	NA	2.48	7.92	Pass
NVNT	ax40	5270	Ant3	5230-5249	5243.34	-23.94	NA	4.0365	NA	7.92	50	Pass
NVNT	ax40	5270	Ant3	5249-5250	5249.99	-11.20	NA	75.8578	NA	50	500	Pass
NVNT	ax40	5270	Ant3	5350-5358.4	5358.17	-44.48	NA	0.0356	NA	15	15	Pass
NVNT	ax40	5270	Ant3	5358.4-26000	24658.30	-36.94	NA	0.2023	NA	2.5	2.5	Pass
NVNT	ax40	5310	Ant1	30-5221.6	3119.00	-47.76	NA	0.0167	NA	2.5	2.5	Pass
NVNT	ax40	5310	Ant1	5221.6-5230	5222.58	-48.49	NA	0.0142	NA	2.48	7.92	Pass
NVNT	ax40	5310	Ant1	5230-5249	5230.47	-48.58	NA	0.0139	NA	7.92	50	Pass
NVNT	ax40	5310	Ant1	5249-5250	5249.10	-45.21	NA	0.0301	NA	50	500	Pass
NVNT	ax40	5310	Ant1	5350-5358.4	5353.21	-42.11	NA	0.0615	NA	15	15	Pass
NVNT	ax40	5310	Ant1	5358.4-26000	24678.94	-37.97	NA	0.1596	NA	2.5	2.5	Pass
NVNT	ax40	5310	Ant2	30-5221.6	3253.98	-45.79	NA	0.0264	NA	2.5	2.5	Pass
NVNT	ax40	5310	Ant2	5221.6-5230	5222.36	-47.68	NA	0.0171	NA	2.48	7.92	Pass
NVNT	ax40	5310	Ant2	5230-5249	5230.63	-46.57	NA	0.022	NA	7.92	50	Pass
NVNT	ax40	5310	Ant2	5249-5250	5249.16	-42.61	NA	0.0548	NA	50	500	Pass
NVNT	ax40	5310	Ant2	5350-5358.4	5350.66	-40.49	NA	0.0893	NA	15	15	Pass
NVNT	ax40	5310	Ant2	5358.4-26000	25256.90	-37.57	NA	0.175	NA	2.5	2.5	Pass
NVNT	ax40	5310	Ant3	30-5221.6	5206.03	-46.51	NA	0.0223	NA	2.5	2.5	Pass
NVNT	ax40	5310	Ant3	5221.6-5230	5221.99	-48.58	NA	0.0139	NA	2.48	7.92	Pass
NVNT	ax40	5310	Ant3	5230-5249	5230.13	-47.07	NA	0.0196	NA	7.92	50	Pass
NVNT	ax40	5310	Ant3	5249-5250	5249.07	-46.25	NA	0.0237	NA	50	500	Pass
NVNT	ax40	5310	Ant3	5350-5358.4	5351.47	-40.62	NA	0.0867	NA	15	15	Pass
NVNT	ax40	5310	Ant3	5358.4-26000	24699.58	-37.08	NA	0.1959	NA	2.5	2.5	Pass
NVNT	ax80	5290	Ant1	30-5203.3	5203.30	-34.81	NA	0.3304	NA	2.5	2.5	Pass
NVNT	ax80	5290	Ant1	5203.3-5290	5204.06	-31.52	NA	0.7047	NA	2.49	3.96	Pass
NVNT	ax80	5290	Ant1	5290-5249	5244.67	-21.39	NA	7.2611	NA	3.96	25	Pass
NVNT	ax80	5290	Ant1	5249-5250	5249.08	-20.71	NA	8.4918	NA	25	250	Pass
NVNT	ax80	5290	Ant1	5350-5376.8	5350.24	-41.36	NA	0.0731	NA	15	15	Pass
NVNT	ax80	5290	Ant1	5376.8-26000	24680.12	-38.78	NA	0.1324	NA	2.5	2.5	Pass
NVNT	ax80	5290	Ant2	30-5203.3	5198.13	-31.26	NA	0.7482	NA	2.5	2.5	Pass
NVNT	ax80	5290	Ant2	5203.3-5290	5208.69	-28.43	NA	1.4355	NA	2.49	3.96	Pass
NVNT	ax80	5290	Ant2	5290-5249	5246.62	-18.32	NA	14.7231	NA	3.96	25	Pass
NVNT	ax80	5290	Ant2	5249-5250	5249.27	-15.12	NA	30.761	NA	25	250	Pass
NVNT	ax80	5290	Ant2	5350-5376.8	5356.35	-39.10	NA	0.123	NA	15	15	Pass
NVNT	ax80	5290	Ant2	5376.8-26000	25340.06	-36.63	NA	0.2173	NA	2.5	2.5	Pass

NVNT	ax80	5290	Ant3	30-5203.3	5203.30	-32.58	NA	0.5521	NA	2.5	2.5	Pass
NVNT	ax80	5290	Ant3	5203.3-5290	5208.66	-29.13	NA	1.2218	NA	2.49	3.96	Pass
NVNT	ax80	5290	Ant3	5290-5249	5235.43	-21.54	NA	7.0146	NA	3.96	25	Pass
NVNT	ax80	5290	Ant3	5249-5250	5249.02	-22.15	NA	6.0954	NA	25	250	Pass
NVNT	ax80	5290	Ant3	5350-5376.8	5358.76	-39.64	NA	0.1086	NA	15	15	Pass
NVNT	ax80	5290	Ant3	5376.8-26000	25360.68	-37.22	NA	0.1897	NA	2.5	2.5	Pass
NVNT	n20	5260	Ant1	30-5233.3	5233.30	-42.55	NA	0.0556	NA	2.5	2.5	Pass
NVNT	n20	5260	Ant1	5233.3-5240	5233.61	-41.09	NA	0.0778	NA	2.49	15.85	Pass
NVNT	n20	5260	Ant1	5240-5249	5248.77	-16.15	NA	24.2661	NA	15.85	100	Pass
NVNT	n20	5260	Ant1	5249-5250	5249.06	-13.20	NA	47.863	NA	100	1000	Pass
NVNT	n20	5260	Ant1	5350-26000	25339.20	-39.37	NA	0.1156	NA	2.5	2.5	Pass
NVNT	n20	5260	Ant2	30-5233.3	5233.30	-42.29	NA	0.059	NA	2.5	2.5	Pass
NVNT	n20	5260	Ant2	5233.3-5240	5235.08	-37.23	NA	0.1892	NA	2.49	15.85	Pass
NVNT	n20	5260	Ant2	5240-5249	5248.93	-13.08	NA	49.204	NA	15.85	100	Pass
NVNT	n20	5260	Ant2	5249-5250	5249.01	-11.87	NA	65.013	NA	100	1000	Pass
NVNT	n20	5260	Ant2	5350-26000	25359.85	-36.92	NA	0.2032	NA	2.5	2.5	Pass
NVNT	n20	5260	Ant3	30-5233.3	5233.30	-42.94	NA	0.0508	NA	2.5	2.5	Pass
NVNT	n20	5260	Ant3	5233.3-5240	5234.23	-38.25	NA	0.1496	NA	2.49	15.85	Pass
NVNT	n20	5260	Ant3	5240-5249	5248.96	-14.09	NA	38.9942	NA	15.85	100	Pass
NVNT	n20	5260	Ant3	5249-5250	5249.07	-12.80	NA	52.4807	NA	100	1000	Pass
NVNT	n20	5260	Ant3	5350-26000	24657.75	-37.46	NA	0.1795	NA	2.5	2.5	Pass
NVNT	n20	5300	Ant1	30-5233.3	3271.66	-47.56	NA	0.0175	NA	2.5	2.5	Pass
NVNT	n20	5300	Ant1	5233.3-5240	5233.59	-49.37	NA	0.0116	NA	2.49	15.85	Pass
NVNT	n20	5300	Ant1	5240-5249	5240.02	-49.53	NA	0.0111	NA	15.85	100	Pass
NVNT	n20	5300	Ant1	5249-5250	5249.02	-49.80	NA	0.0105	NA	100	1000	Pass
NVNT	n20	5300	Ant1	5350-26000	24699.05	-38.71	NA	0.1346	NA	2.5	2.5	Pass
NVNT	n20	5300	Ant2	30-5233.3	5150.05	-45.95	NA	0.0254	NA	2.5	2.5	Pass
NVNT	n20	5300	Ant2	5233.3-5240	5233.39	-47.14	NA	0.0193	NA	2.49	15.85	Pass
NVNT	n20	5300	Ant2	5240-5249	5240.31	-48.02	NA	0.0158	NA	15.85	100	Pass
NVNT	n20	5300	Ant2	5249-5250	5249.03	-47.84	NA	0.0164	NA	100	1000	Pass
NVNT	n20	5300	Ant2	5350-26000	25339.20	-36.75	NA	0.2113	NA	2.5	2.5	Pass
NVNT	n20	5300	Ant3	30-5233.3	2798.16	-46.83	NA	0.0207	NA	2.5	2.5	Pass
NVNT	n20	5300	Ant3	5233.3-5240	5233.48	-48.12	NA	0.0154	NA	2.49	15.85	Pass
NVNT	n20	5300	Ant3	5240-5249	5240.45	-48.15	NA	0.0153	NA	15.85	100	Pass
NVNT	n20	5300	Ant3	5249-5250	5249.01	-48.04	NA	0.0157	NA	100	1000	Pass
NVNT	n20	5300	Ant3	5350-26000	25194.65	-38.21	NA	0.151	NA	2.5	2.5	Pass
NVNT	n20	5320	Ant1	30-5233.3	3105.15	-47.77	NA	0.0167	NA	2.5	2.5	Pass
NVNT	n20	5320	Ant1	5233.3-5240	5234.15	-48.47	NA	0.0142	NA	2.49	15.85	Pass
NVNT	n20	5320	Ant1	5240-5249	5240.15	-48.01	NA	0.0158	NA	15.85	100	Pass
NVNT	n20	5320	Ant1	5249-5250	5249.06	-48.51	NA	0.0141	NA	100	1000	Pass
NVNT	n20	5320	Ant1	5350-26000	5350.00	-31.78	NA	0.6637	NA	2.5	2.5	Pass
NVNT	n20	5320	Ant2	30-5233.3	2537.99	-46.55	NA	0.0221	NA	2.5	2.5	Pass

NVNT	n20	5320	Ant2	5233.3-5240	5233.37	-47.93	NA	0.0161	NA	2.49	15.85	Pass
NVNT	n20	5320	Ant2	5240-5249	5240.54	-47.01	NA	0.0199	NA	15.85	100	Pass
NVNT	n20	5320	Ant2	5249-5250	5249.10	-46.35	NA	0.0232	NA	100	1000	Pass
NVNT	n20	5320	Ant2	5350-26000	5350.00	-29.87	NA	1.0304	NA	2.5	2.5	Pass
NVNT	n20	5320	Ant3	30-5233.3	5202.08	-45.96	NA	0.0254	NA	2.5	2.5	Pass
NVNT	n20	5320	Ant3	5233.3-5240	5233.39	-48.43	NA	0.0144	NA	2.49	15.85	Pass
NVNT	n20	5320	Ant3	5240-5249	5240.00	-47.98	NA	0.0159	NA	15.85	100	Pass
NVNT	n20	5320	Ant3	5249-5250	5249.01	-49.02	NA	0.0125	NA	100	1000	Pass
NVNT	n20	5320	Ant3	5350-26000	5350.00	-30.70	NA	0.8511	NA	2.5	2.5	Pass
NVNT	n40	5270	Ant1	30-5221.6	5216.41	-46.72	NA	0.0213	NA	2.5	2.5	Pass
NVNT	n40	5270	Ant1	5221.6-5230	5228.00	-40.19	NA	0.0957	NA	2.48	7.92	Pass
NVNT	n40	5270	Ant1	5230-5249	5248.96	-22.91	NA	5.1168	NA	7.92	50	Pass
NVNT	n40	5270	Ant1	5249-5250	5249.19	-19.71	NA	10.6905	NA	50	500	Pass
NVNT	n40	5270	Ant1	5350-5358.4	5350.81	-48.96	NA	0.0127	NA	15	15	Pass
NVNT	n40	5270	Ant1	5358.4-26000	24678.94	-38.61	NA	0.1377	NA	2.5	2.5	Pass
NVNT	n40	5270	Ant2	30-5221.6	5221.60	-45.22	NA	0.0301	NA	2.5	2.5	Pass
NVNT	n40	5270	Ant2	5221.6-5230	5227.69	-38.30	NA	0.1479	NA	2.48	7.92	Pass
NVNT	n40	5270	Ant2	5230-5249	5248.89	-21.15	NA	7.6736	NA	7.92	50	Pass
NVNT	n40	5270	Ant2	5249-5250	5249.17	-18.06	NA	15.6315	NA	50	500	Pass
NVNT	n40	5270	Ant2	5350-5358.4	5353.14	-46.65	NA	0.0216	NA	15	15	Pass
NVNT	n40	5270	Ant2	5358.4-26000	25401.39	-37.10	NA	0.195	NA	2.5	2.5	Pass
NVNT	n40	5270	Ant3	30-5221.6	5221.60	-44.78	NA	0.0333	NA	2.5	2.5	Pass
NVNT	n40	5270	Ant3	5221.6-5230	5222.08	-43.45	NA	0.0452	NA	2.48	7.92	Pass
NVNT	n40	5270	Ant3	5230-5249	5248.98	-22.23	NA	5.9841	NA	7.92	50	Pass
NVNT	n40	5270	Ant3	5249-5250	5249.06	-20.34	NA	9.247	NA	50	500	Pass
NVNT	n40	5270	Ant3	5350-5358.4	5356.43	-47.56	NA	0.0175	NA	15	15	Pass
NVNT	n40	5270	Ant3	5358.4-26000	25339.47	-36.92	NA	0.2032	NA	2.5	2.5	Pass
NVNT	n40	5310	Ant1	30-5221.6	5086.62	-47.76	NA	0.0167	NA	2.5	2.5	Pass
NVNT	n40	5310	Ant1	5221.6-5230	5221.93	-49.28	NA	0.0118	NA	2.48	7.92	Pass
NVNT	n40	5310	Ant1	5230-5249	5233.78	-47.96	NA	0.016	NA	7.92	50	Pass
NVNT	n40	5310	Ant1	5249-5250	5249.33	-42.52	NA	0.056	NA	50	500	Pass
NVNT	n40	5310	Ant1	5350-5358.4	5350.28	-46.19	NA	0.024	NA	15	15	Pass
NVNT	n40	5310	Ant1	5358.4-26000	25380.75	-38.01	NA	0.1581	NA	2.5	2.5	Pass
NVNT	n40	5310	Ant2	30-5221.6	2688.10	-45.90	NA	0.0257	NA	2.5	2.5	Pass
NVNT	n40	5310	Ant2	5221.6-5230	5222.06	-47.87	NA	0.0163	NA	2.48	7.92	Pass
NVNT	n40	5310	Ant2	5230-5249	5230.00	-48.44	NA	0.0143	NA	7.92	50	Pass
NVNT	n40	5310	Ant2	5249-5250	5249.01	-45.88	NA	0.0258	NA	50	500	Pass
NVNT	n40	5310	Ant2	5350-5358.4	5350.45	-45.33	NA	0.0293	NA	15	15	Pass
NVNT	n40	5310	Ant2	5358.4-26000	25277.54	-36.62	NA	0.2178	NA	2.5	2.5	Pass
NVNT	n40	5310	Ant3	30-5221.6	5190.45	-46.65	NA	0.0216	NA	2.5	2.5	Pass
NVNT	n40	5310	Ant3	5221.6-5230	5221.84	-49.57	NA	0.011	NA	2.48	7.92	Pass
NVNT	n40	5310	Ant3	5230-5249	5231.06	-48.87	NA	0.013	NA	7.92	50	Pass



Report No.: AB26060362MW02


NVNT	n40	5310	Ant3	5249-5250	5249.07	-45.94	NA	0.0255	NA	50	500	Pass
NVNT	n40	5310	Ant3	5350-5358.4	5353.07	-45.96	NA	0.0254	NA	15	15	Pass
NVNT	n40	5310	Ant3	5358.4-26000	24678.94	-37.53	NA	0.1766	NA	2.5	2.5	Pass

Test Graphs


Tx. Spurious NVNT a 5260MHz Ant1 @ 30MHz-5233.3MHz




Tx. Spurious NVNT a 5260MHz Ant1 @ 5233.3MHz-5240MHz

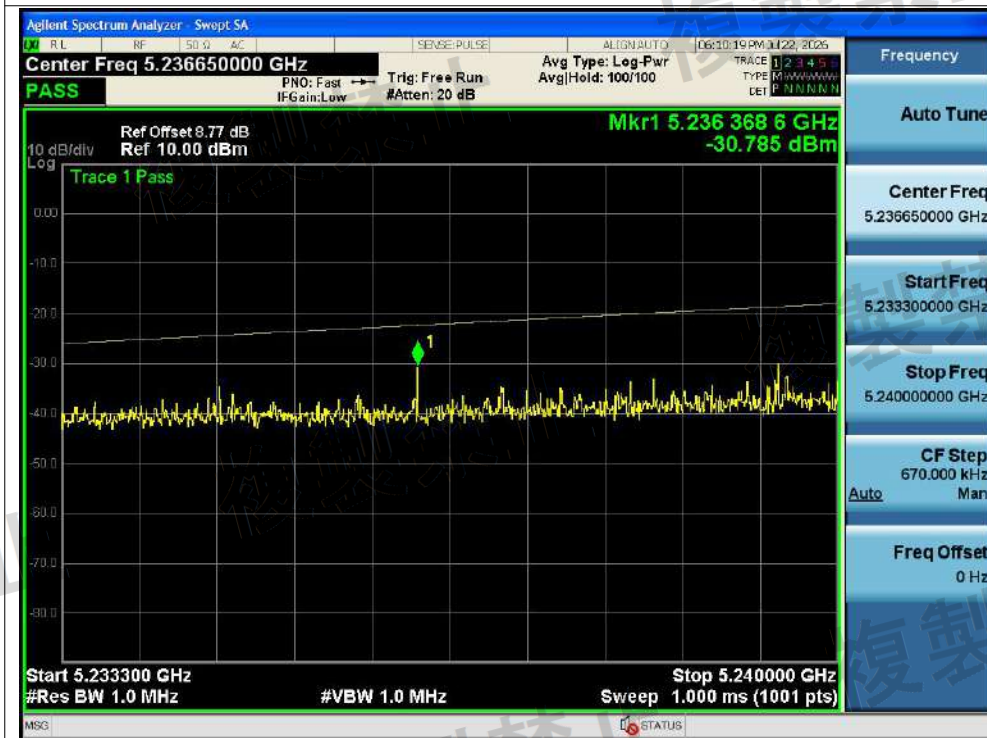

Tx. Spurious NVNT a 5260MHz Ant1 @ 5240MHz-5249MHz

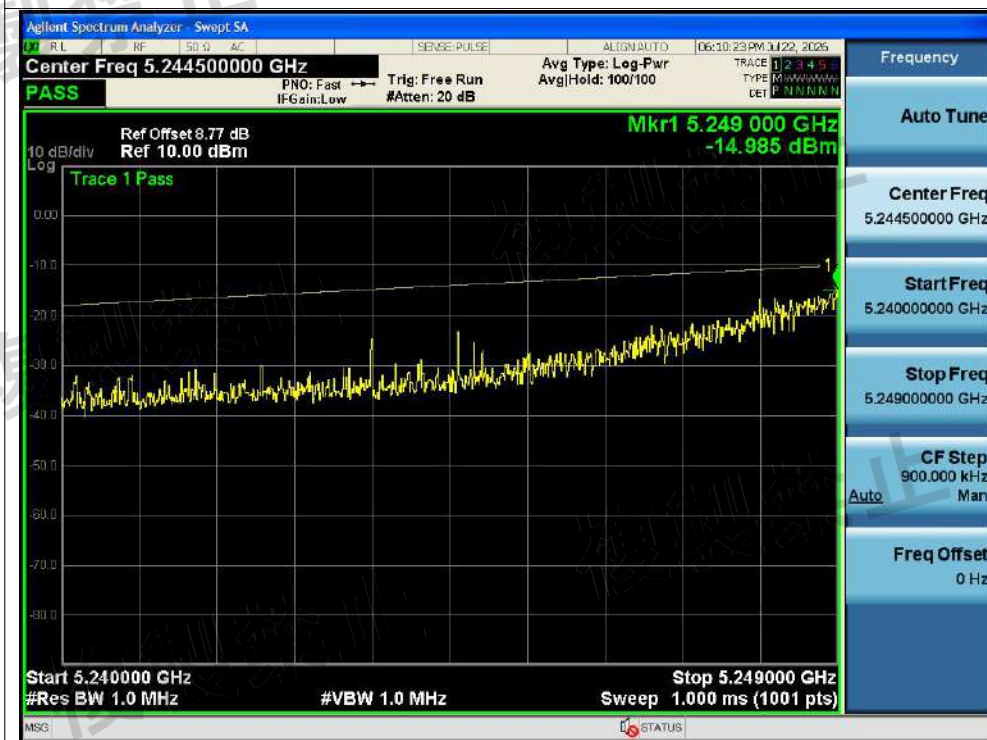

Tx. Spurious NVNT a 5260MHz Ant1 @ 5249MHz-5250MHz

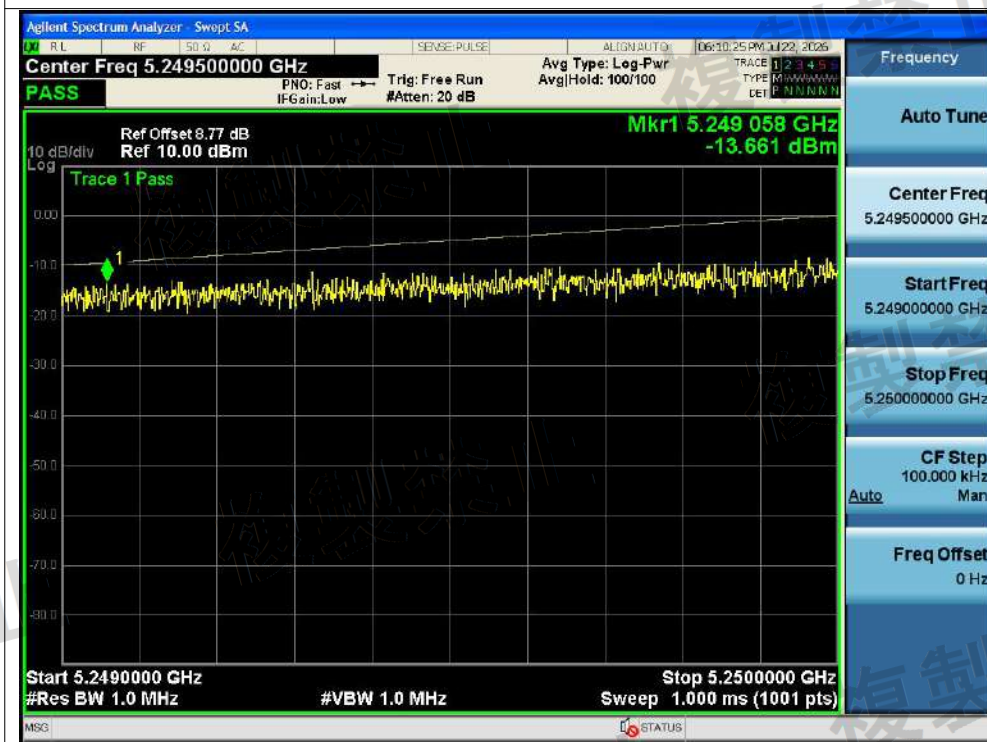


Tx. Spurious NVNT a 5260MHz Ant1 @ 5350MHz-26000MHz




Tx. Spurious NVNT a 5300MHz Ant1 @ 30MHz-5233.3MHz




Tx. Spurious NVNT a 5300MHz Ant1 @ 5233.3MHz-5240MHz

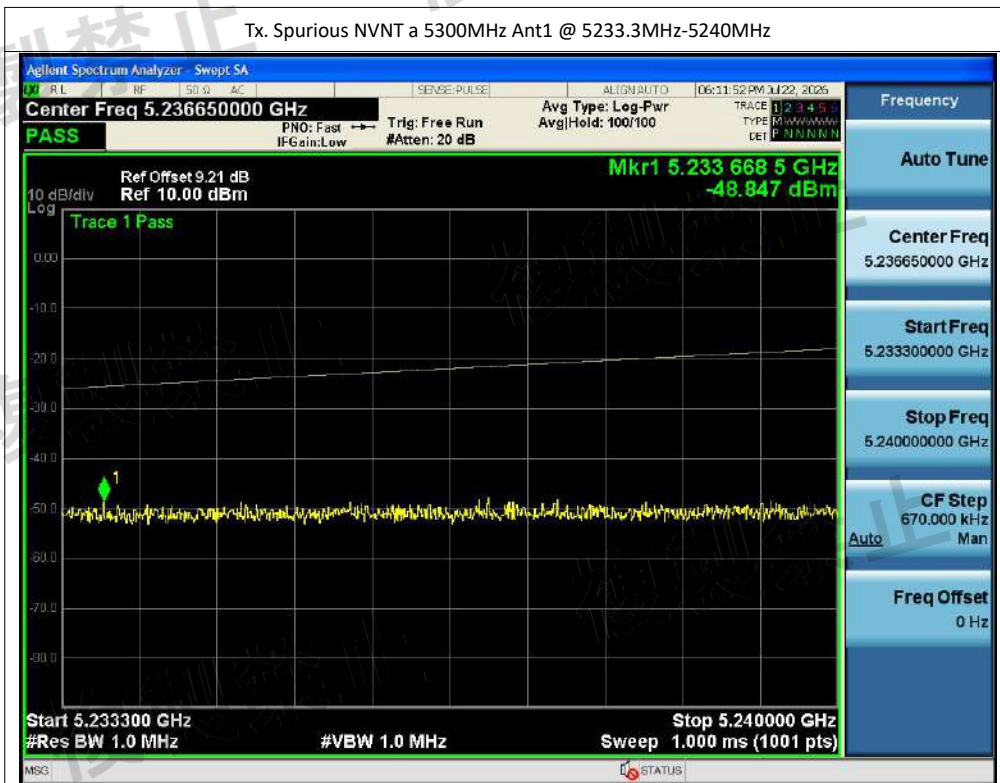

Tx. Spurious NVNT a 5300MHz Ant1 @ 5240MHz-5249MHz

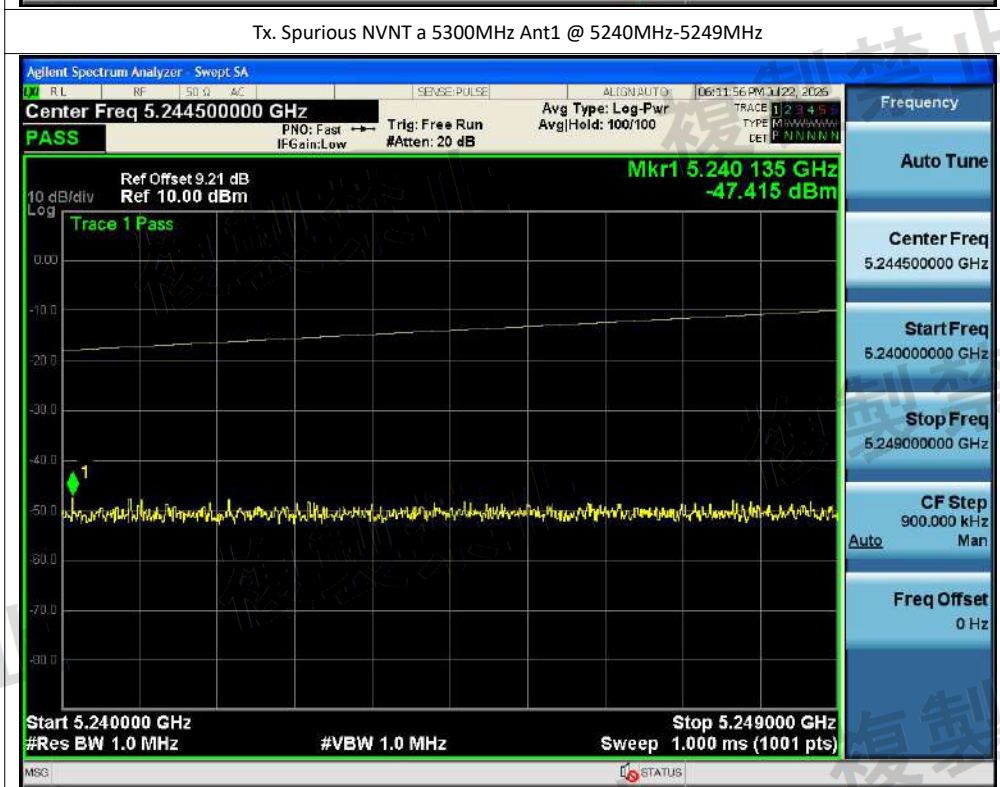


Tx. Spurious NVNT a 5300MHz Ant1 @ 5249MHz-5250MHz

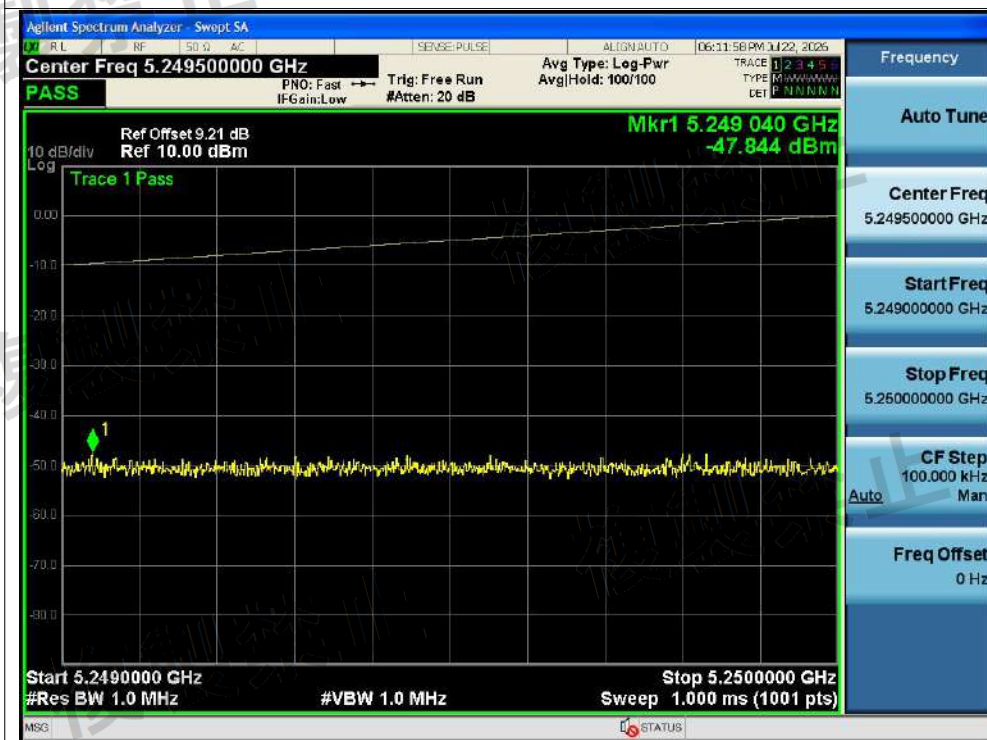


Tx. Spurious NVNT a 5300MHz Ant1 @ 5350MHz-26000MHz




Tx. Spurious NVNT a 5320MHz Ant1 @ 30MHz-5233.3MHz

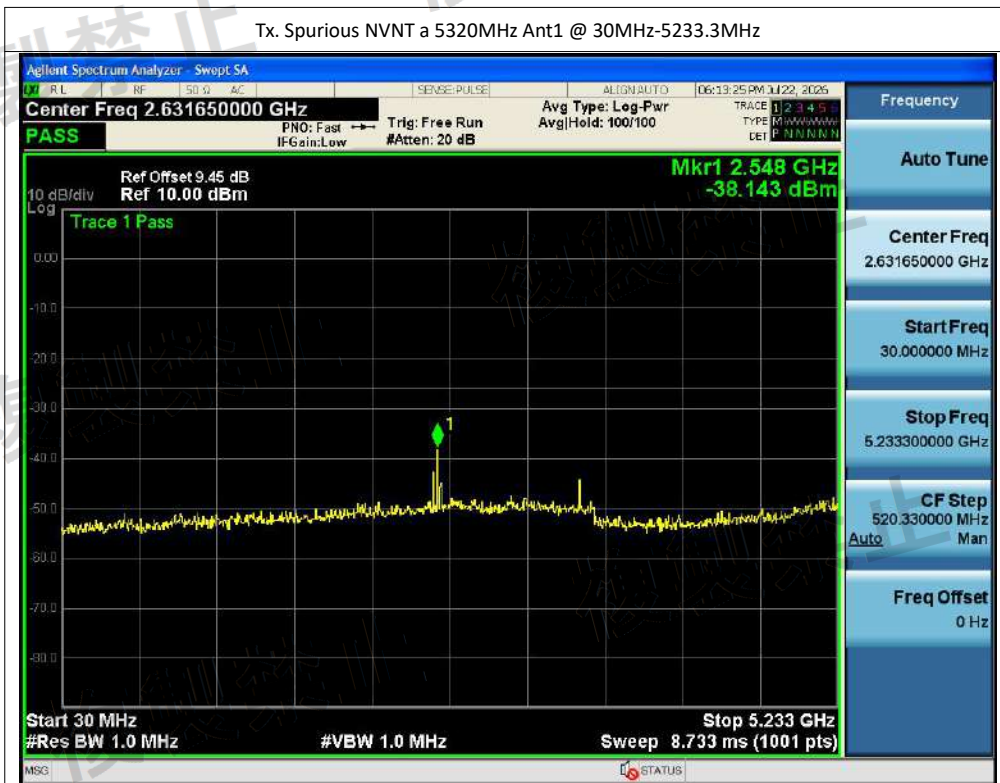


Tx. Spurious NVNT a 5320MHz Ant1 @ 5233.3MHz-5240MHz

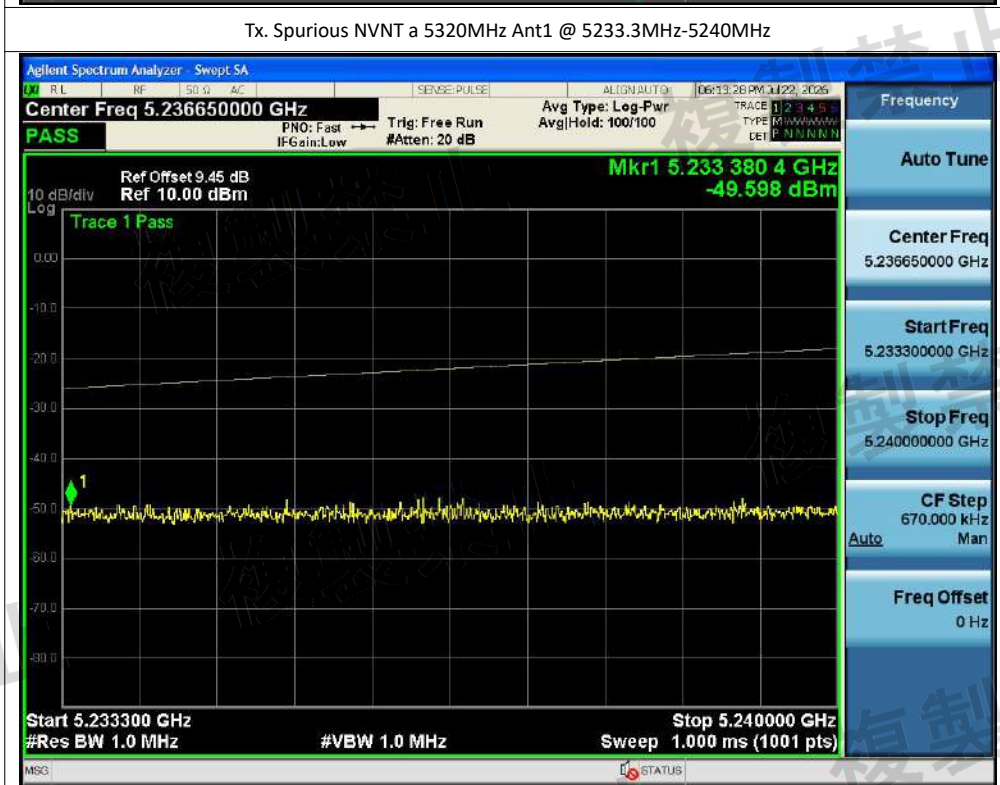


Tx. Spurious NVNT a 5320MHz Ant1 @ 5240MHz-5249MHz

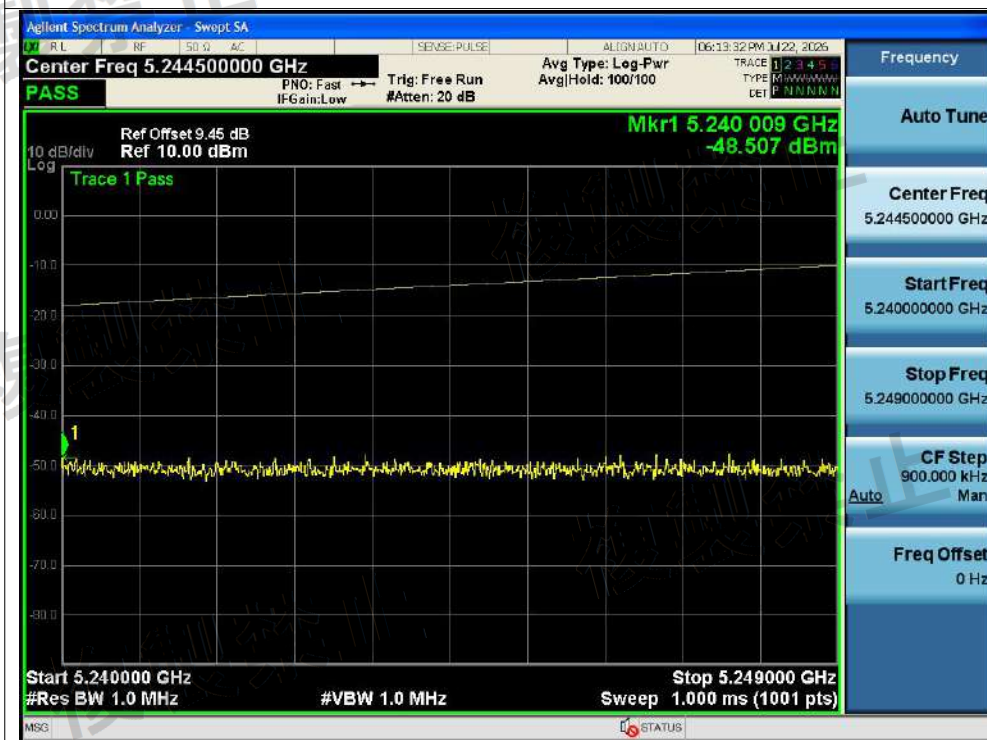


Tx. Spurious NVNT a 5320MHz Ant1 @ 5249MHz-5250MHz

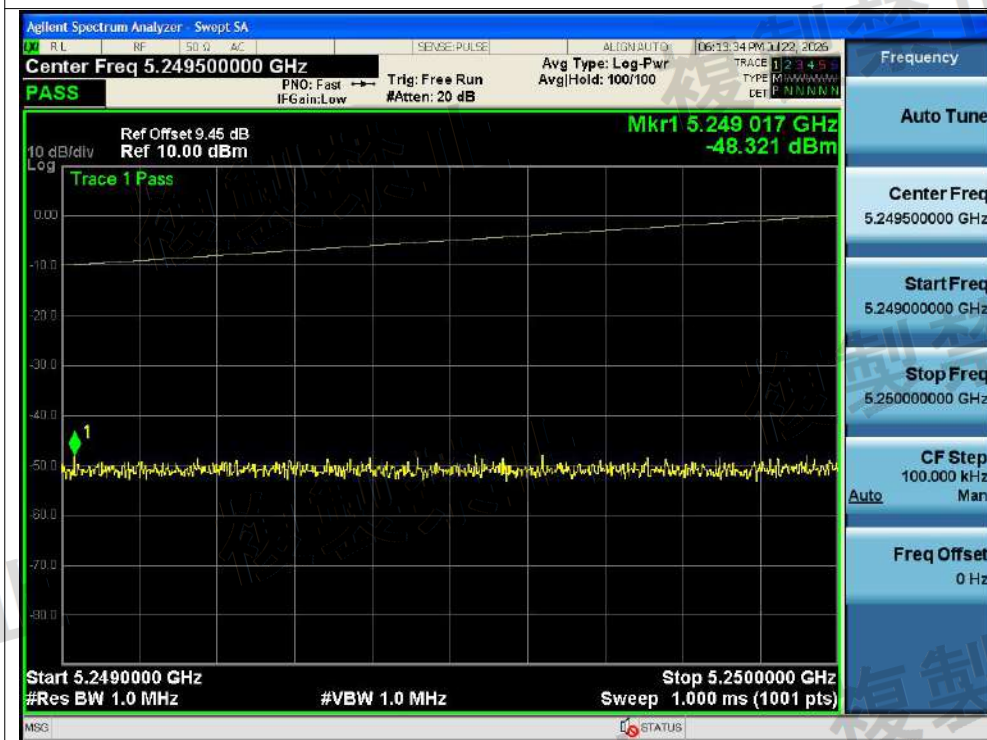


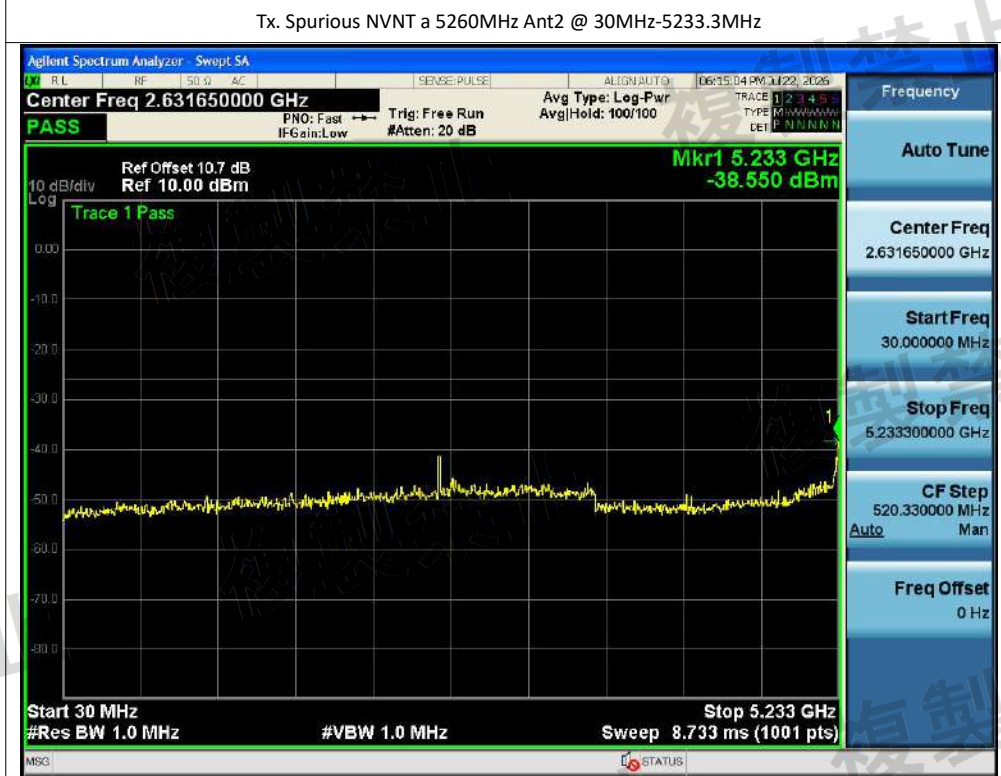


Tx. Spurious NVNT a 5260MHz Ant2 @ 5233.3MHz-5240MHz

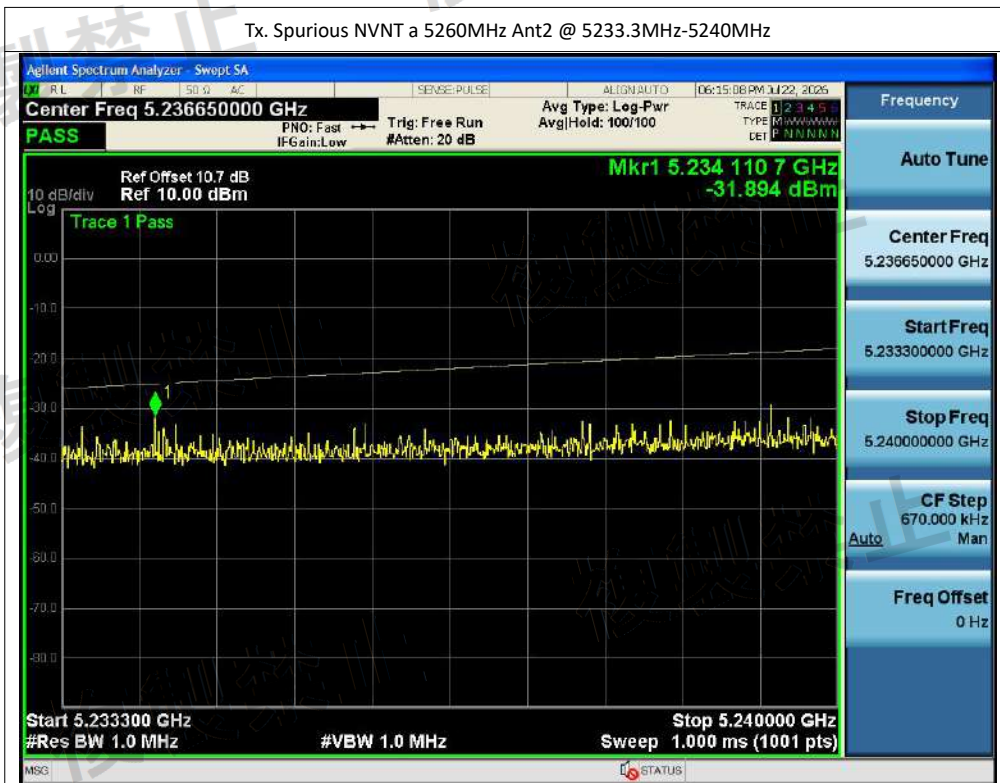

Tx. Spurious NVNT a 5260MHz Ant2 @ 5240MHz-5249MHz

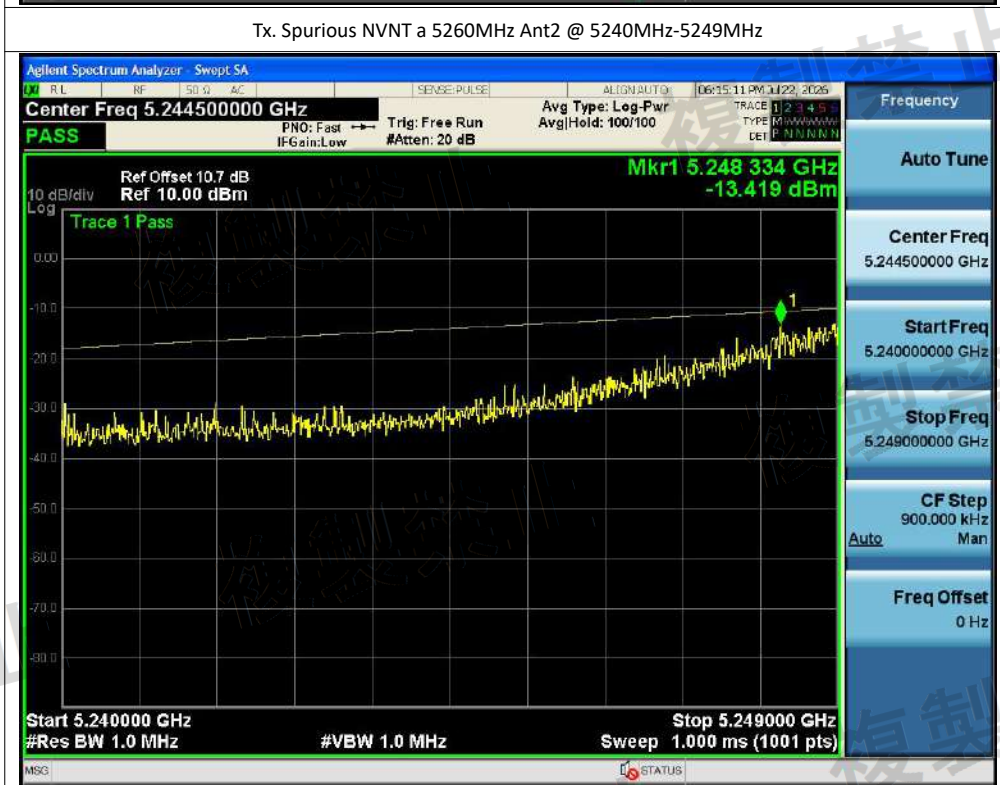


Tx. Spurious NVNT a 5260MHz Ant2 @ 5249MHz-5250MHz

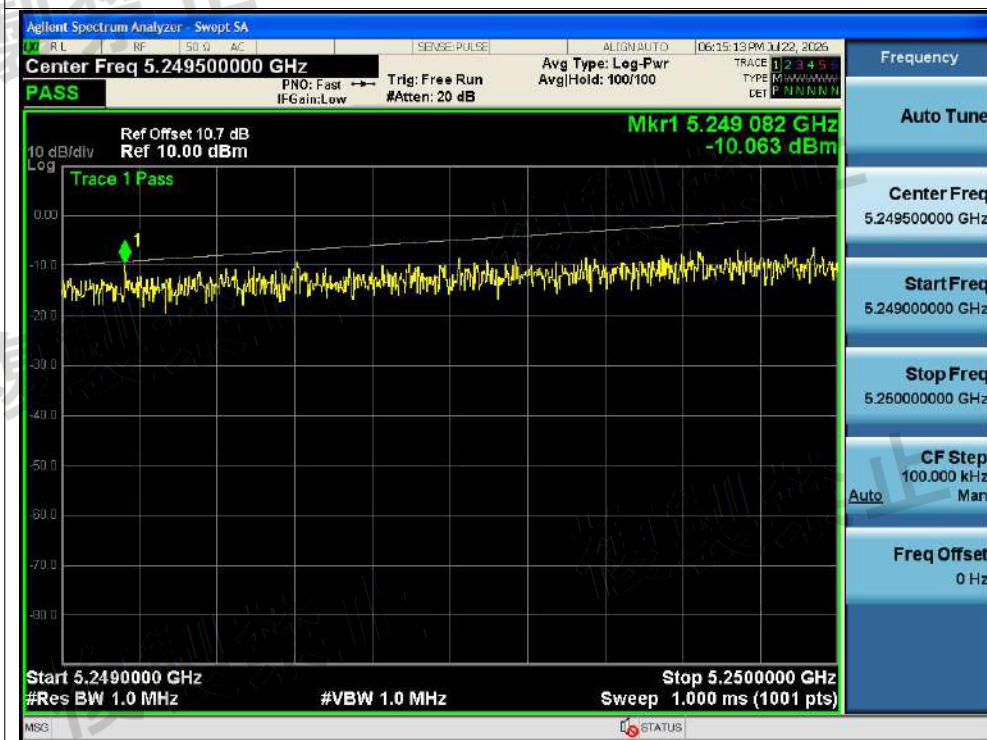


Tx. Spurious NVNT a 5260MHz Ant2 @ 5350MHz-26000MHz




Tx. Spurious NVNT a 5300MHz Ant2 @ 30MHz-5233.3MHz

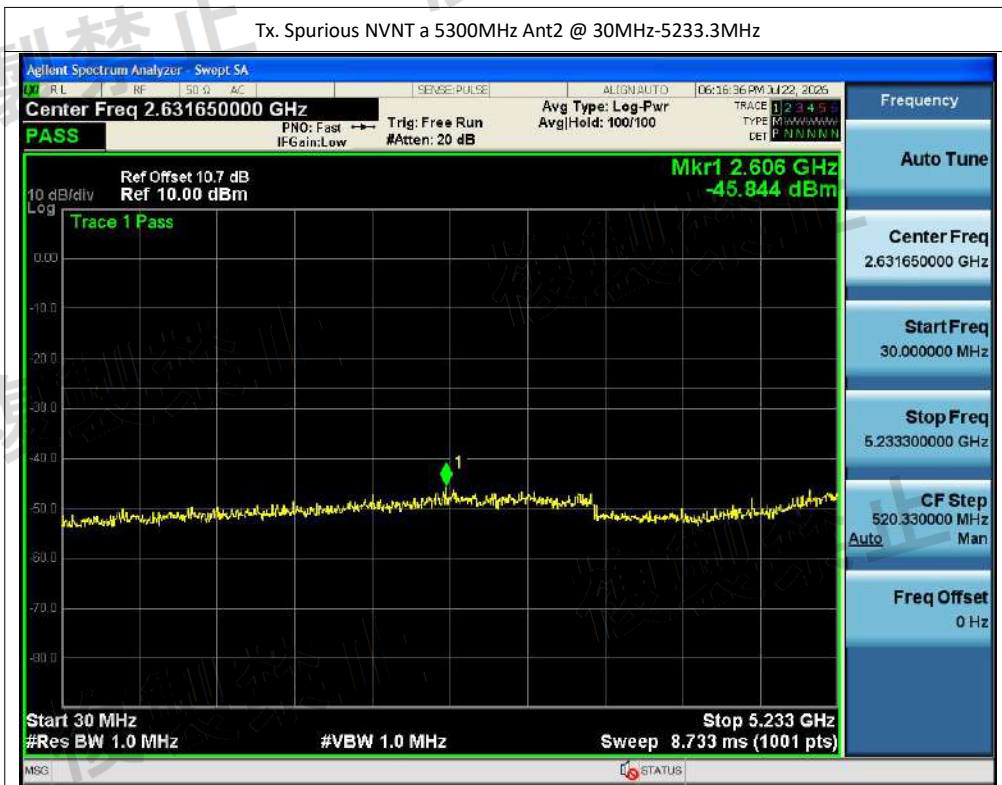


Tx. Spurious NVNT a 5300MHz Ant2 @ 5233.3MHz-5240MHz

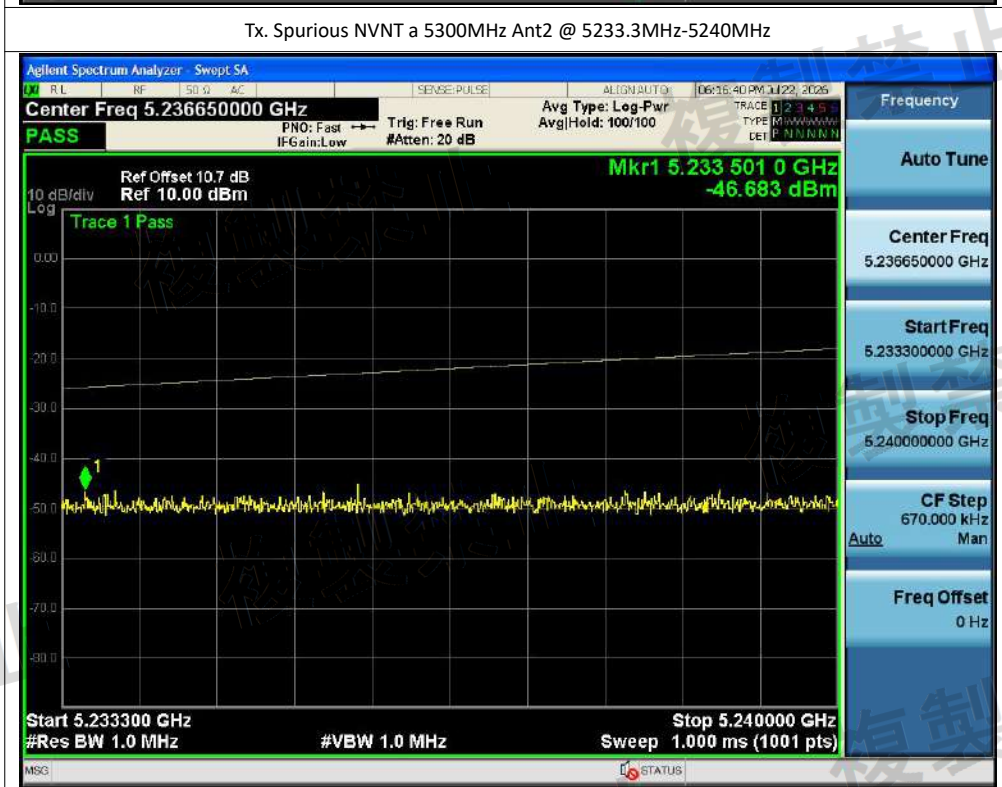


Tx. Spurious NVNT a 5300MHz Ant2 @ 5240MHz-5249MHz

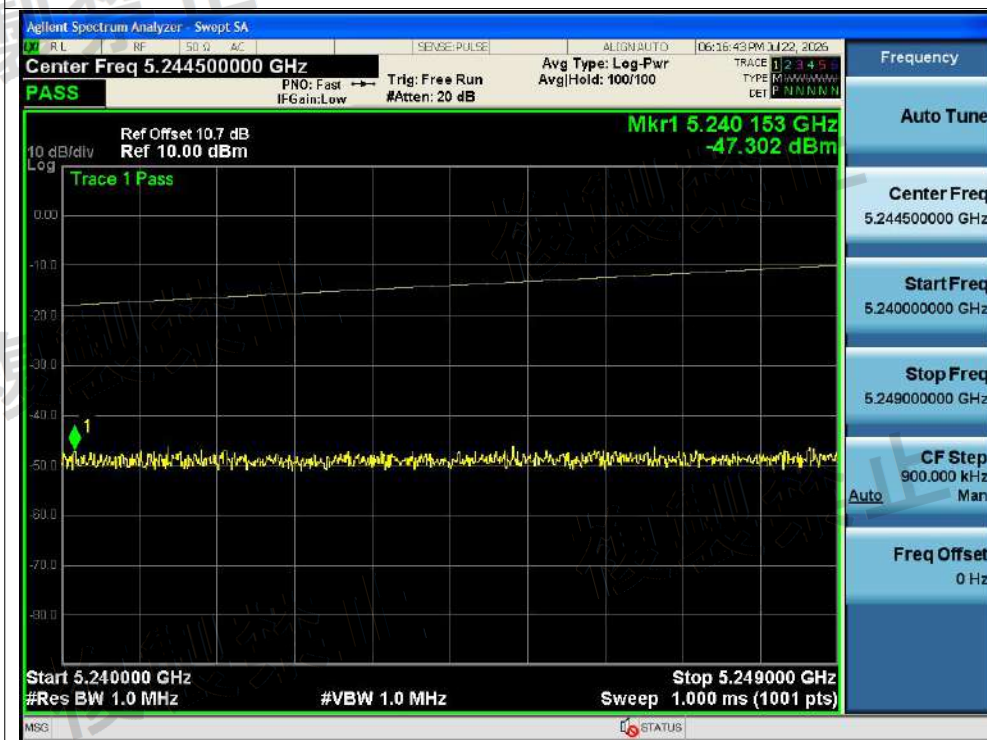


Tx. Spurious NVNT a 5300MHz Ant2 @ 5249MHz-5250MHz

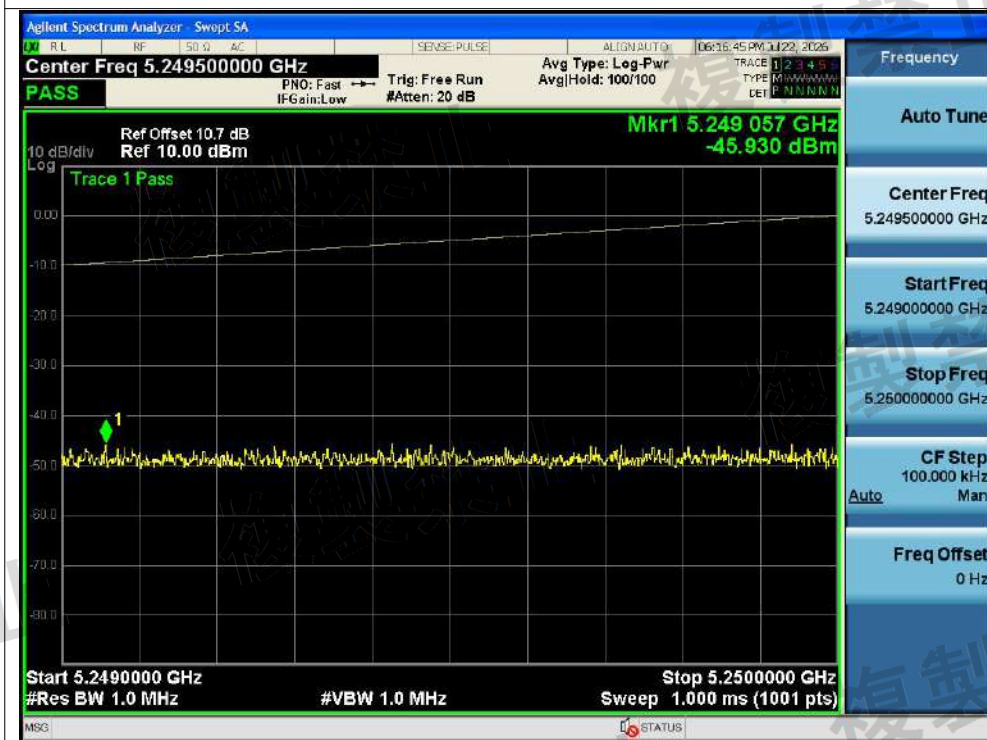


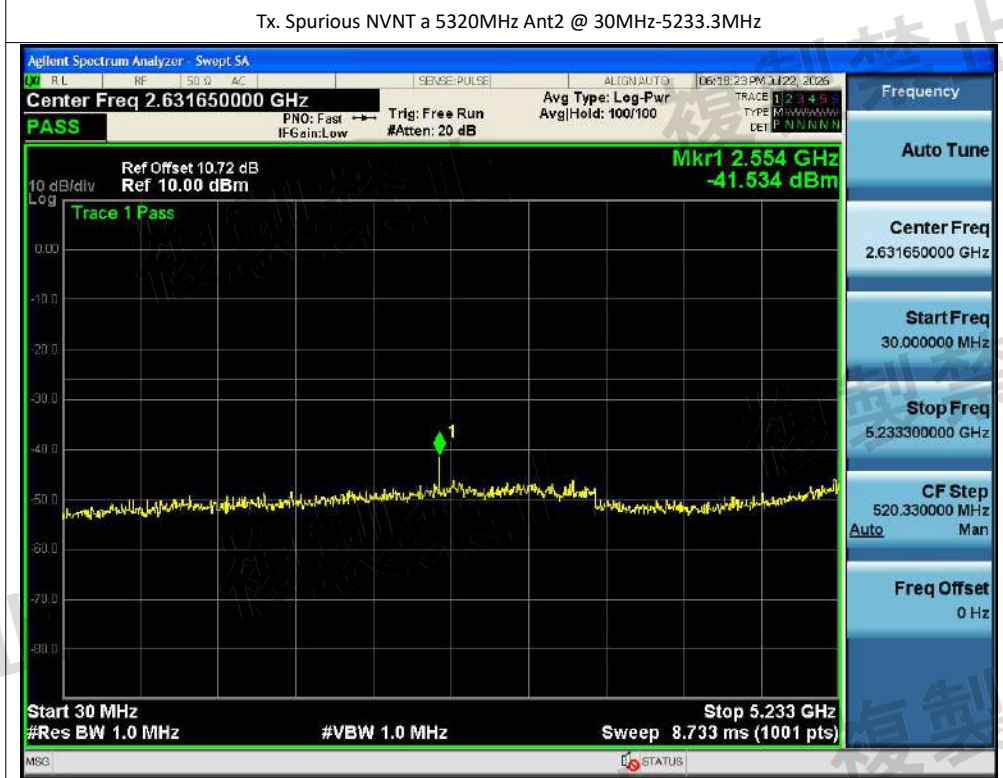

Tx. Spurious NVNT a 5320MHz Ant2 @ 5233.3MHz-5240MHz

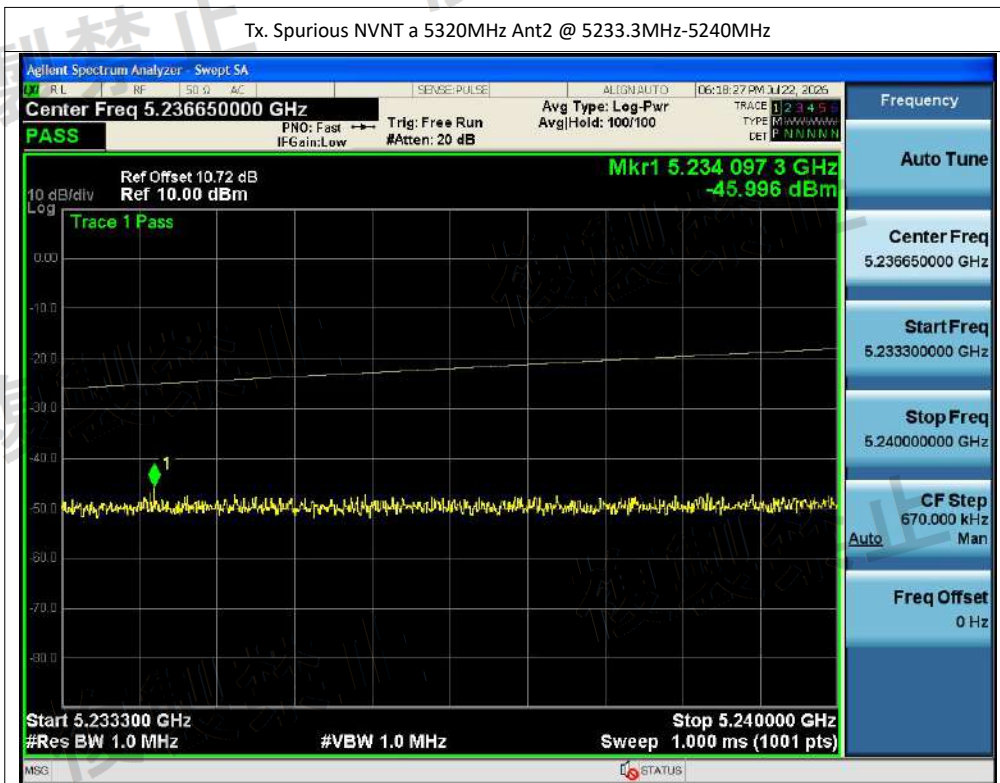

Tx. Spurious NVNT a 5320MHz Ant2 @ 5240MHz-5249MHz

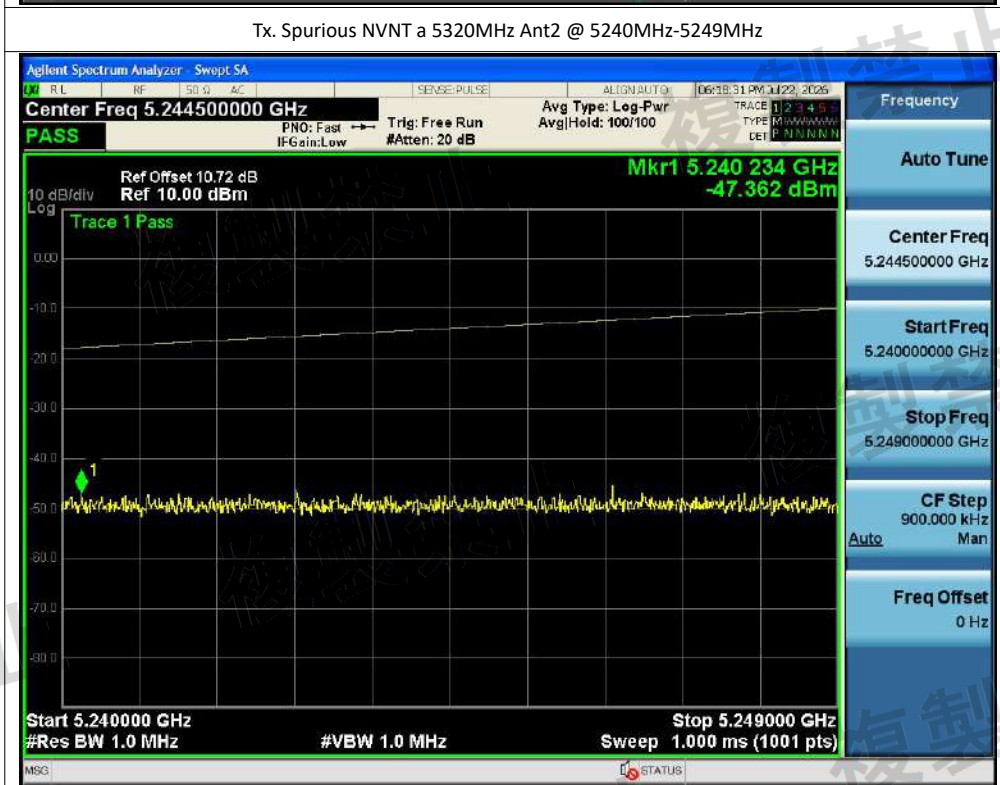


Tx. Spurious NVNT a 5320MHz Ant2 @ 5249MHz-5250MHz




Tx. Spurious NVNT a 5320MHz Ant2 @ 5350MHz-26000MHz




Tx. Spurious NVNT a 5260MHz Ant3 @ 30MHz-5233.3MHz

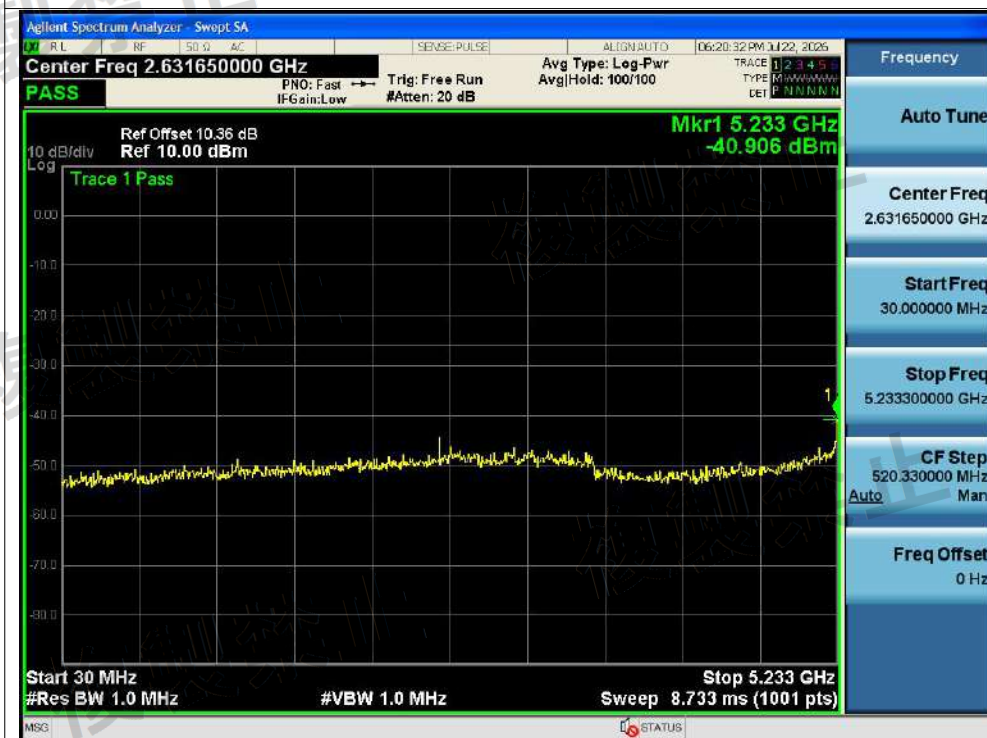


Tx. Spurious NVNT a 5260MHz Ant3 @ 5233.3MHz-5240MHz

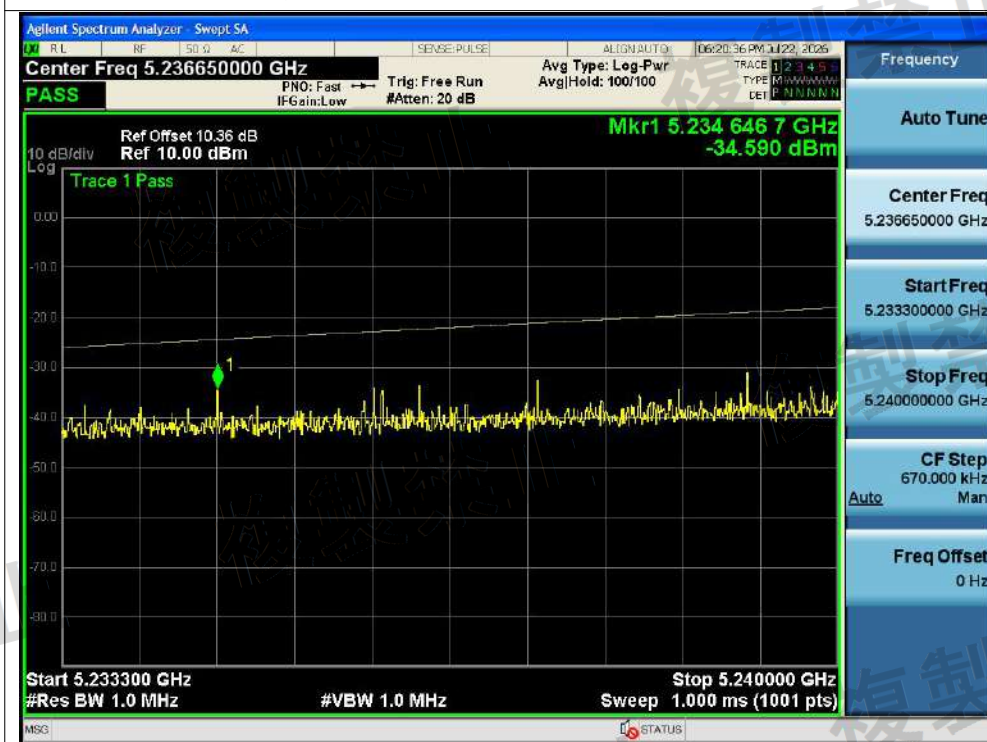

Tx. Spurious NVNT a 5260MHz Ant3 @ 5240MHz-5249MHz

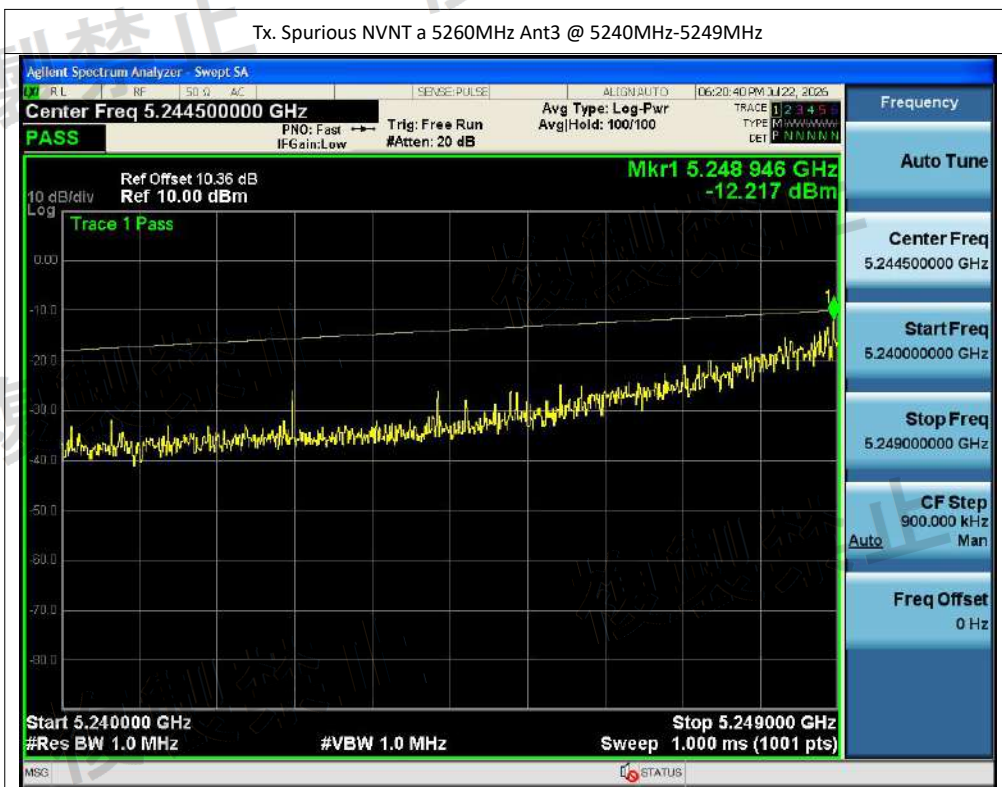


Tx. Spurious NVNT a 5260MHz Ant3 @ 5249MHz-5250MHz

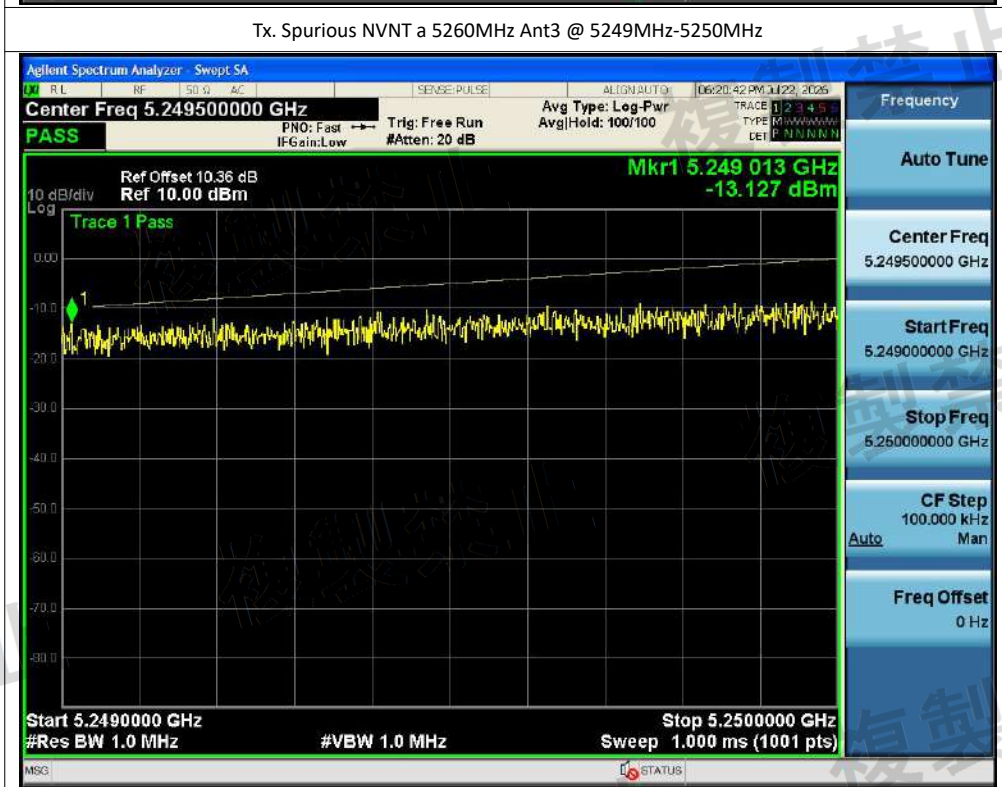


Tx. Spurious NVNT a 5260MHz Ant3 @ 5350MHz-26000MHz




Tx. Spurious NVNT a 5300MHz Ant3 @ 30MHz-5233.3MHz

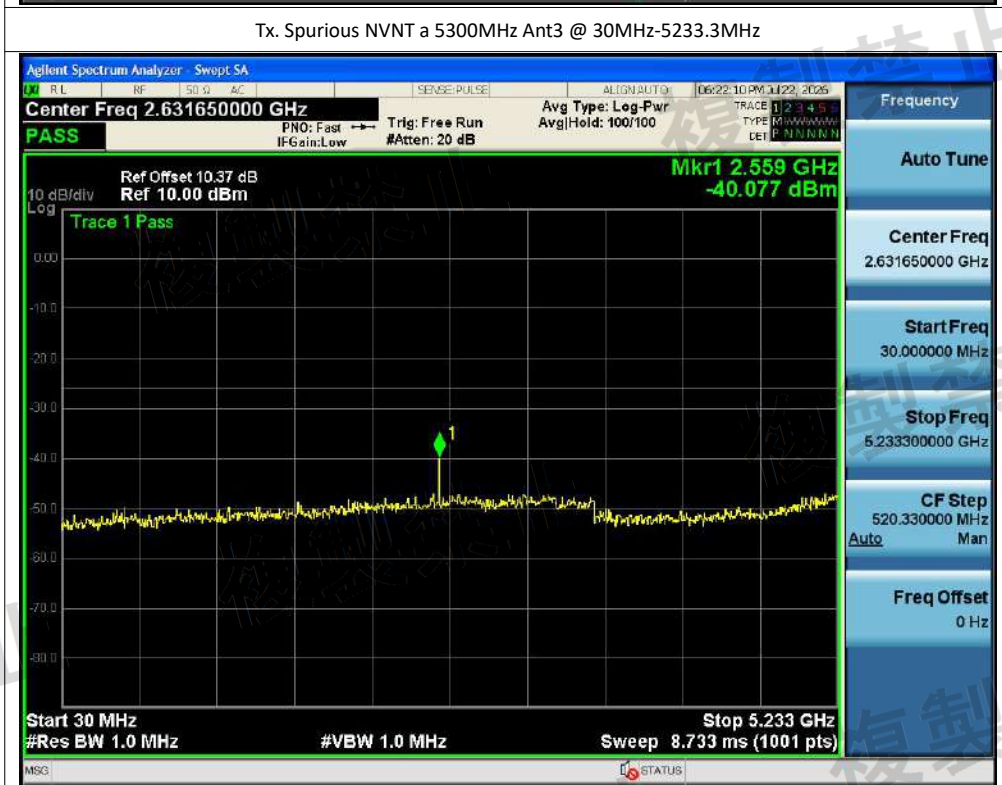


Tx. Spurious NVNT a 5300MHz Ant3 @ 5233.3MHz-5240MHz

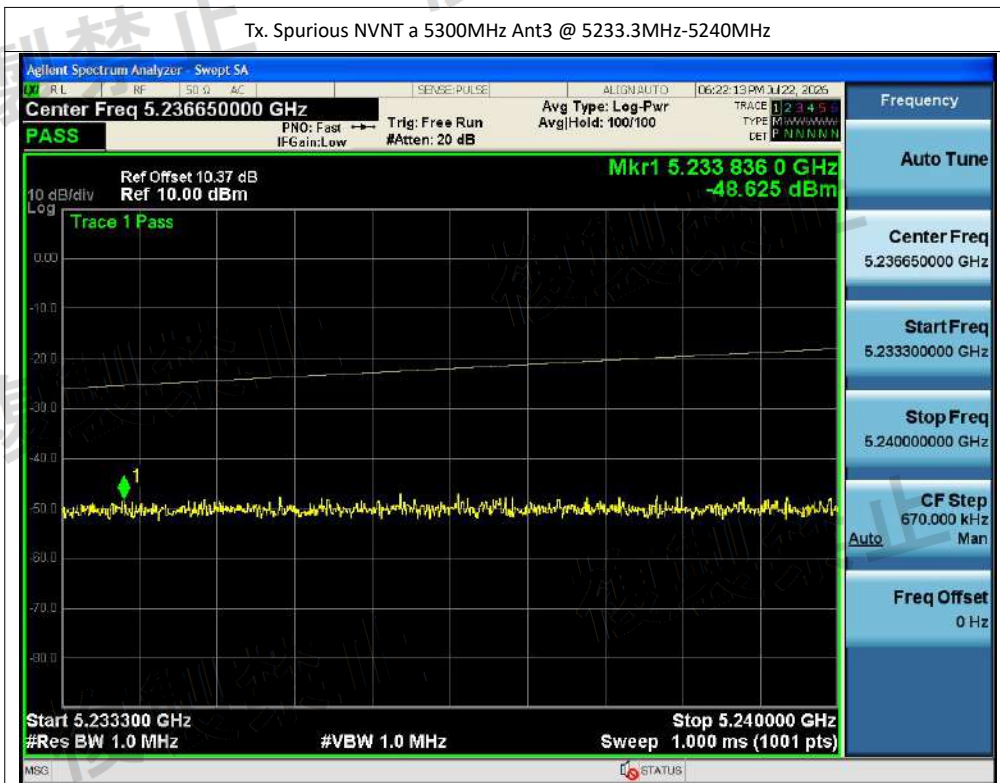

Tx. Spurious NVNT a 5300MHz Ant3 @ 5240MHz-5249MHz

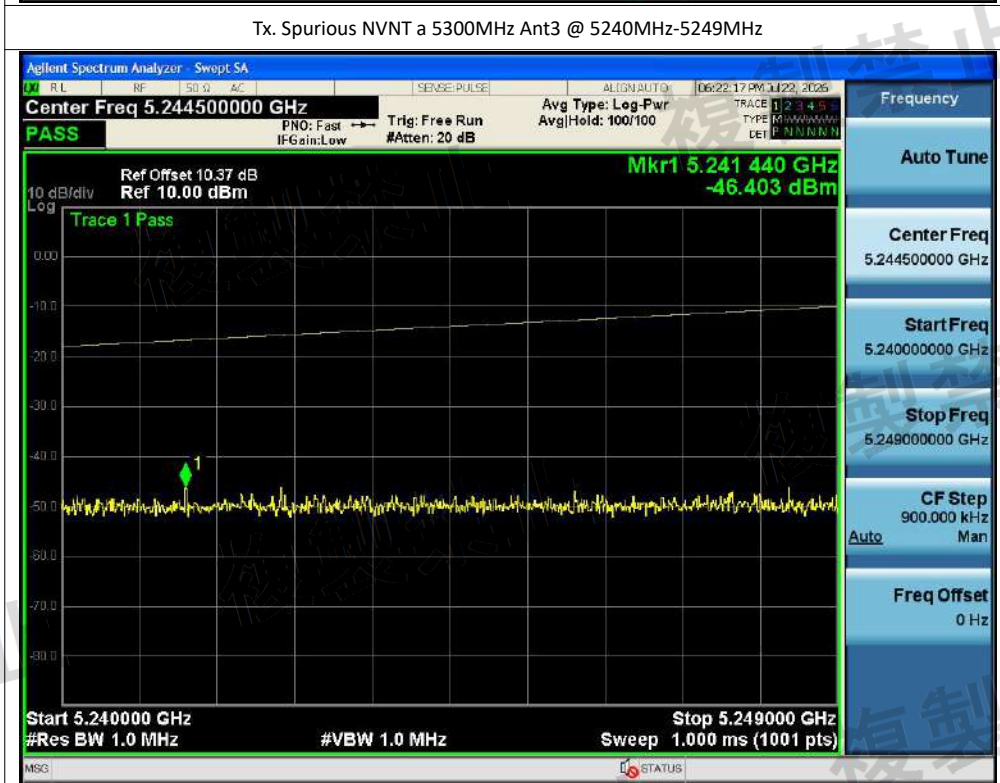


Tx. Spurious NVNT a 5300MHz Ant3 @ 5249MHz-5250MHz

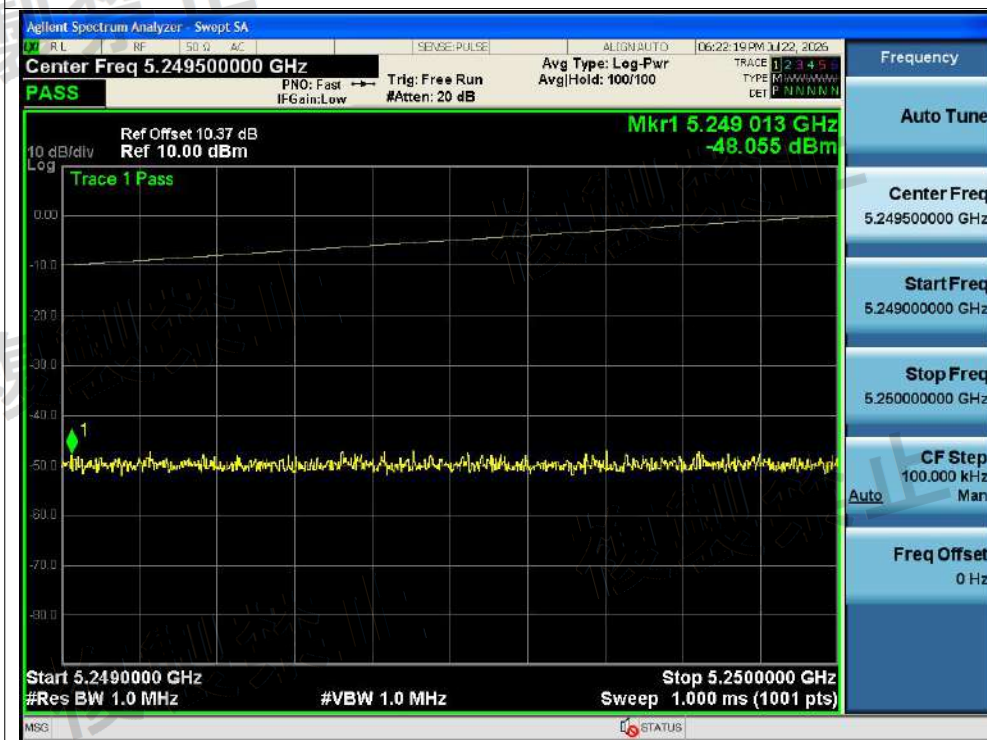


Tx. Spurious NVNT a 5300MHz Ant3 @ 5350MHz-26000MHz




Tx. Spurious NVNT a 5320MHz Ant3 @ 30MHz-5233.3MHz

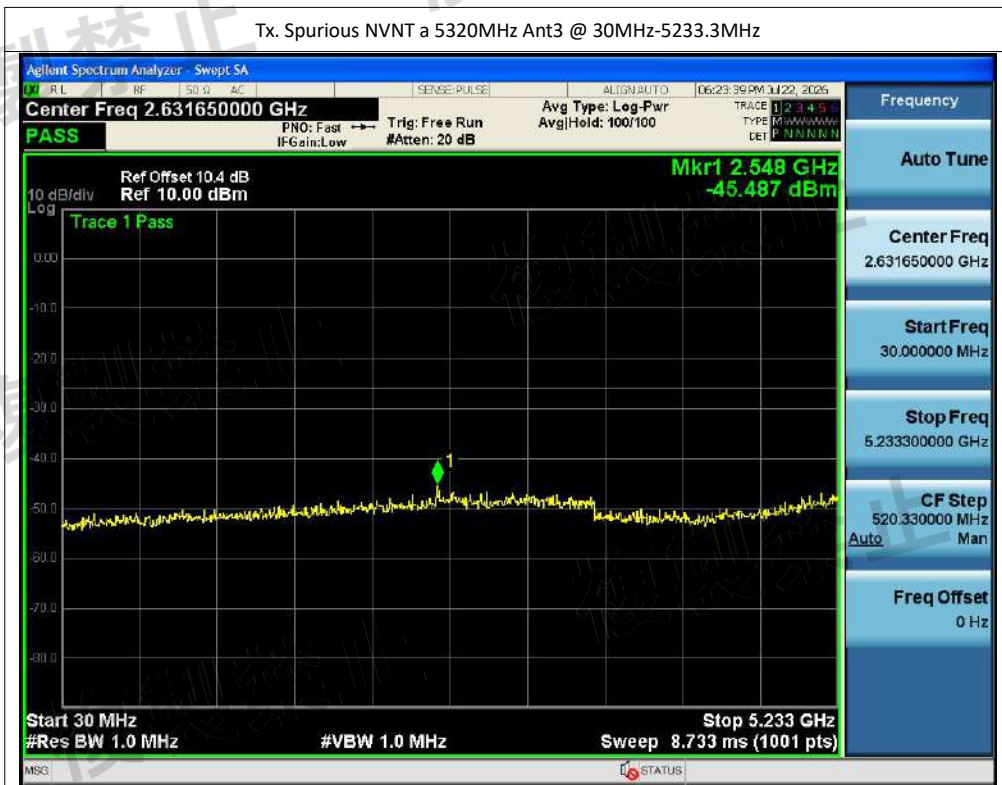


Tx. Spurious NVNT a 5320MHz Ant3 @ 5233.3MHz-5240MHz

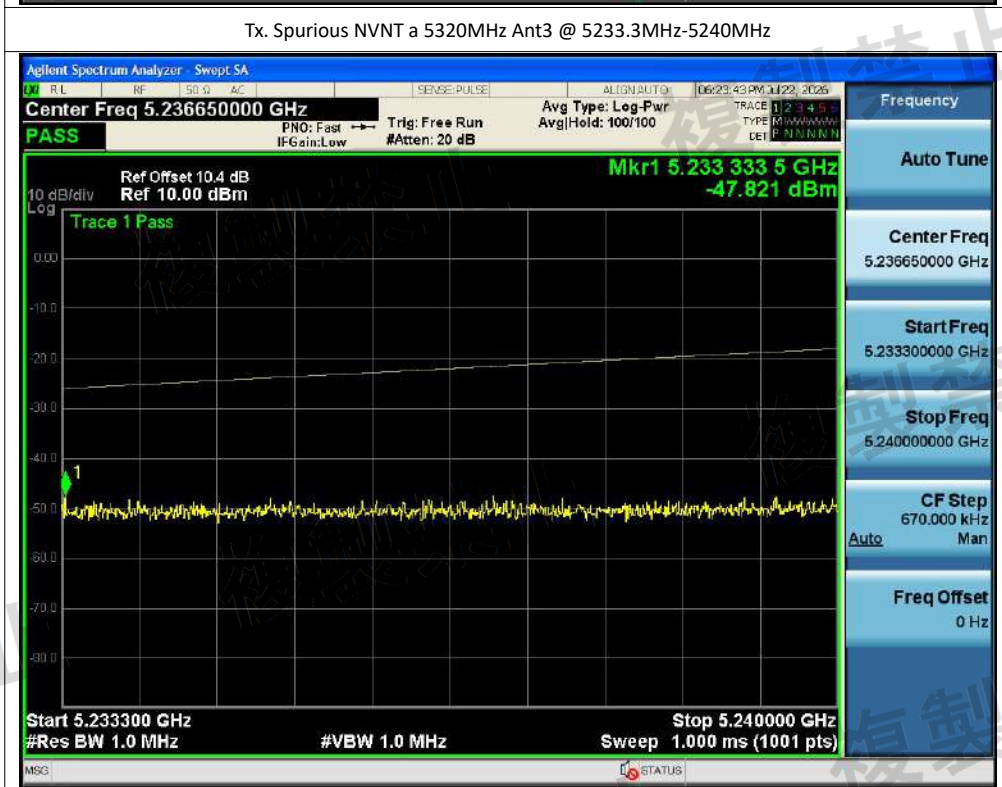

Tx. Spurious NVNT a 5320MHz Ant3 @ 5240MHz-5249MHz

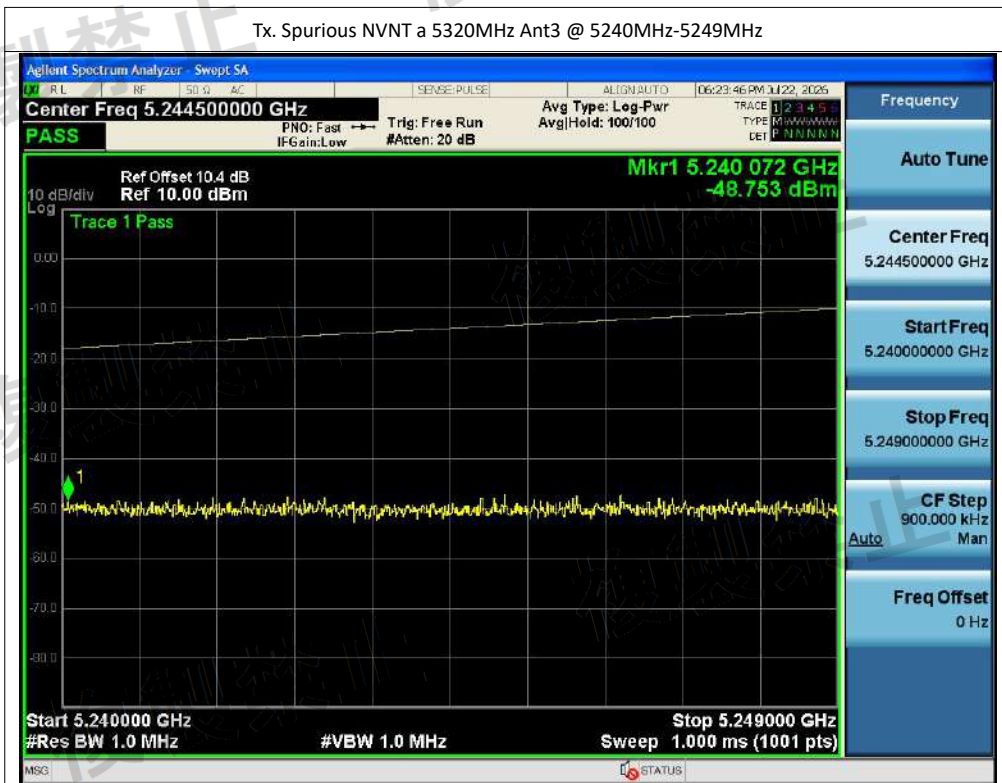


Tx. Spurious NVNT a 5320MHz Ant3 @ 5249MHz-5250MHz

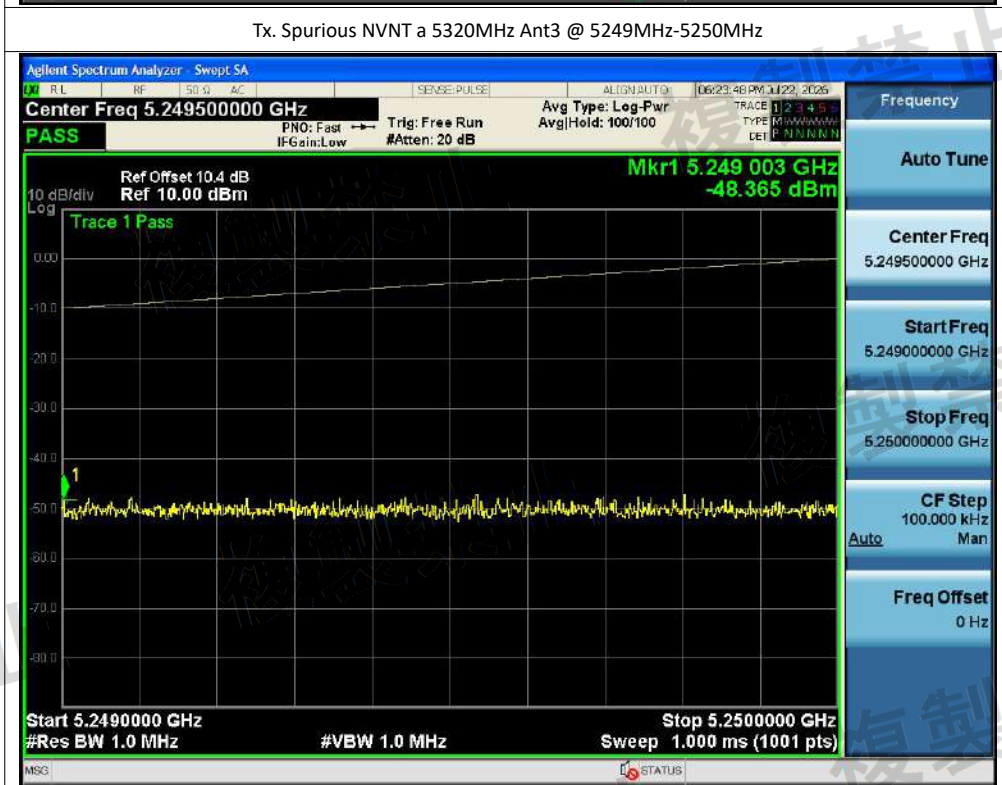





Tx. Spurious NVNT ac20 5260MHz Ant1 @ 5233.3MHz-5240MHz

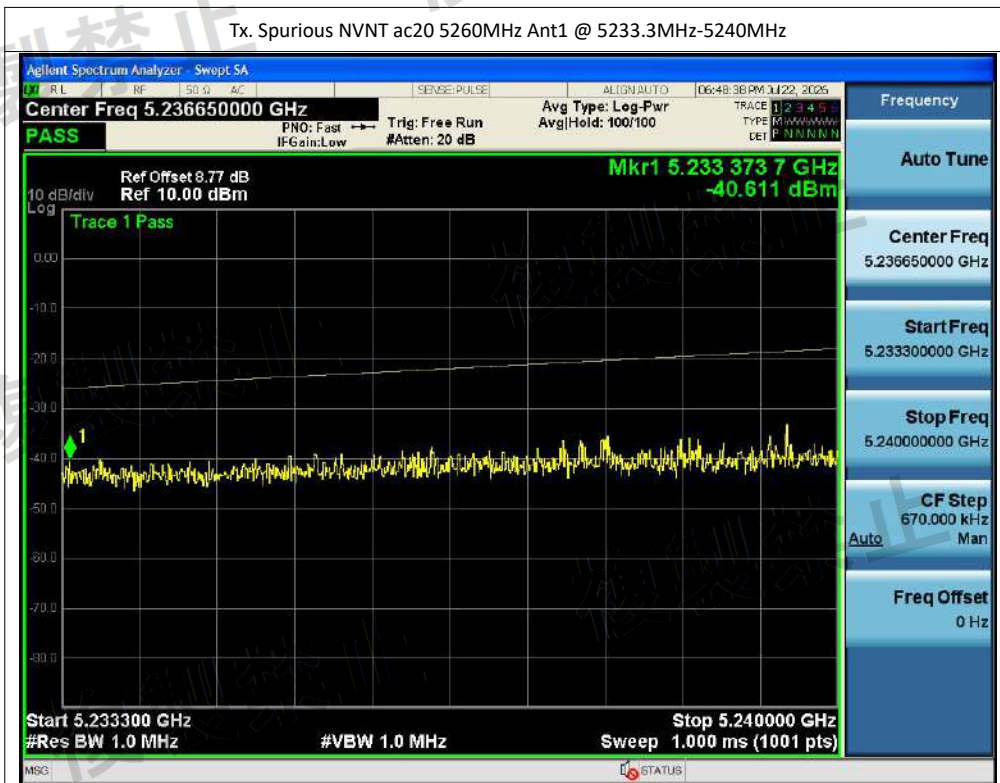

Tx. Spurious NVNT ac20 5260MHz Ant1 @ 5240MHz-5249MHz

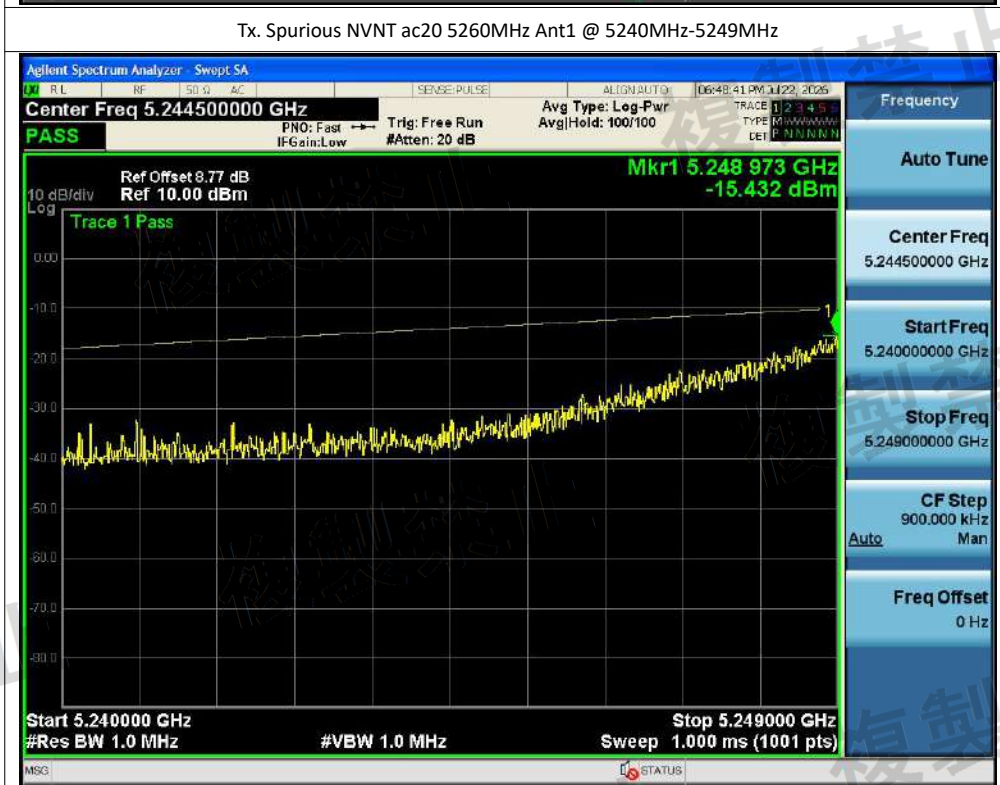

Tx. Spurious NVNT ac20 5260MHz Ant1 @ 5249MHz-5250MHz

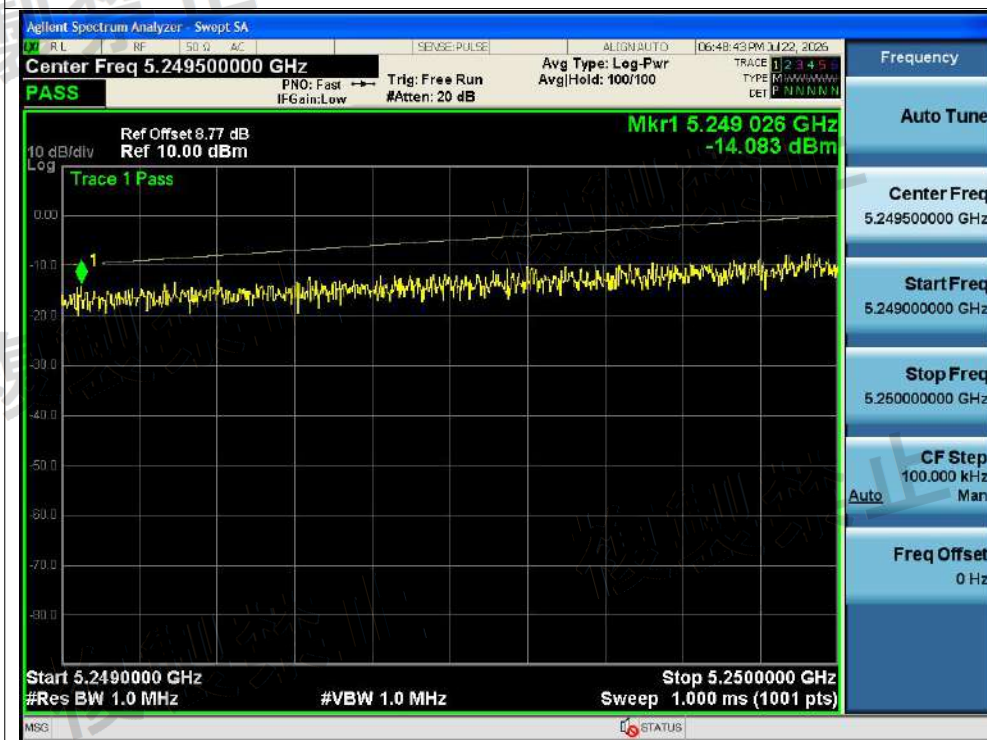

Tx. Spurious NVNT ac20 5260MHz Ant1 @ 5350MHz-26000MHz

