









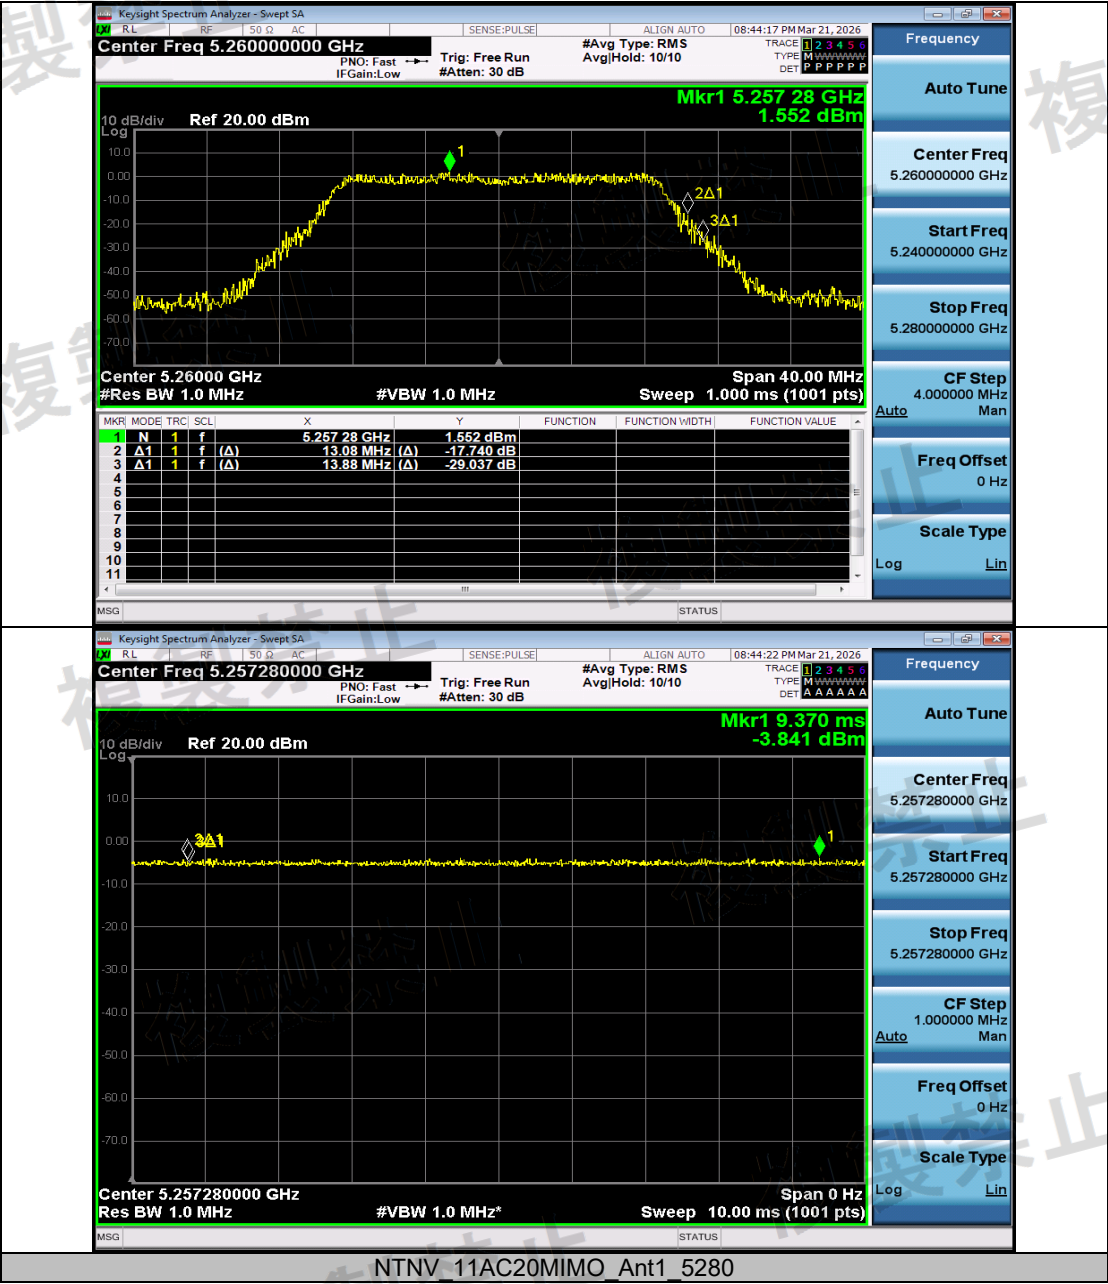

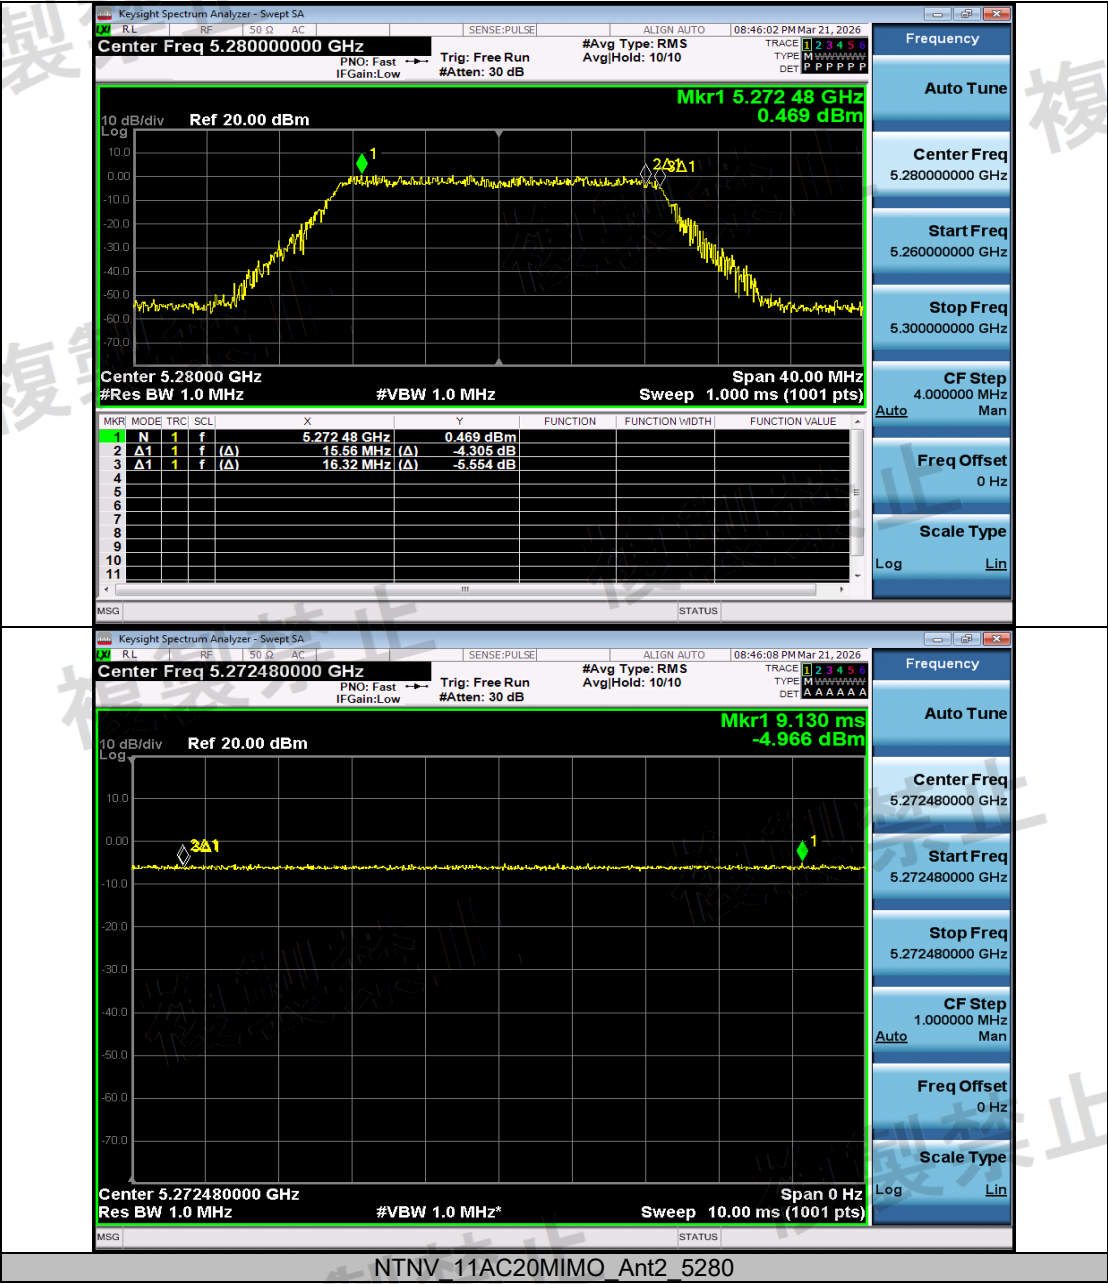


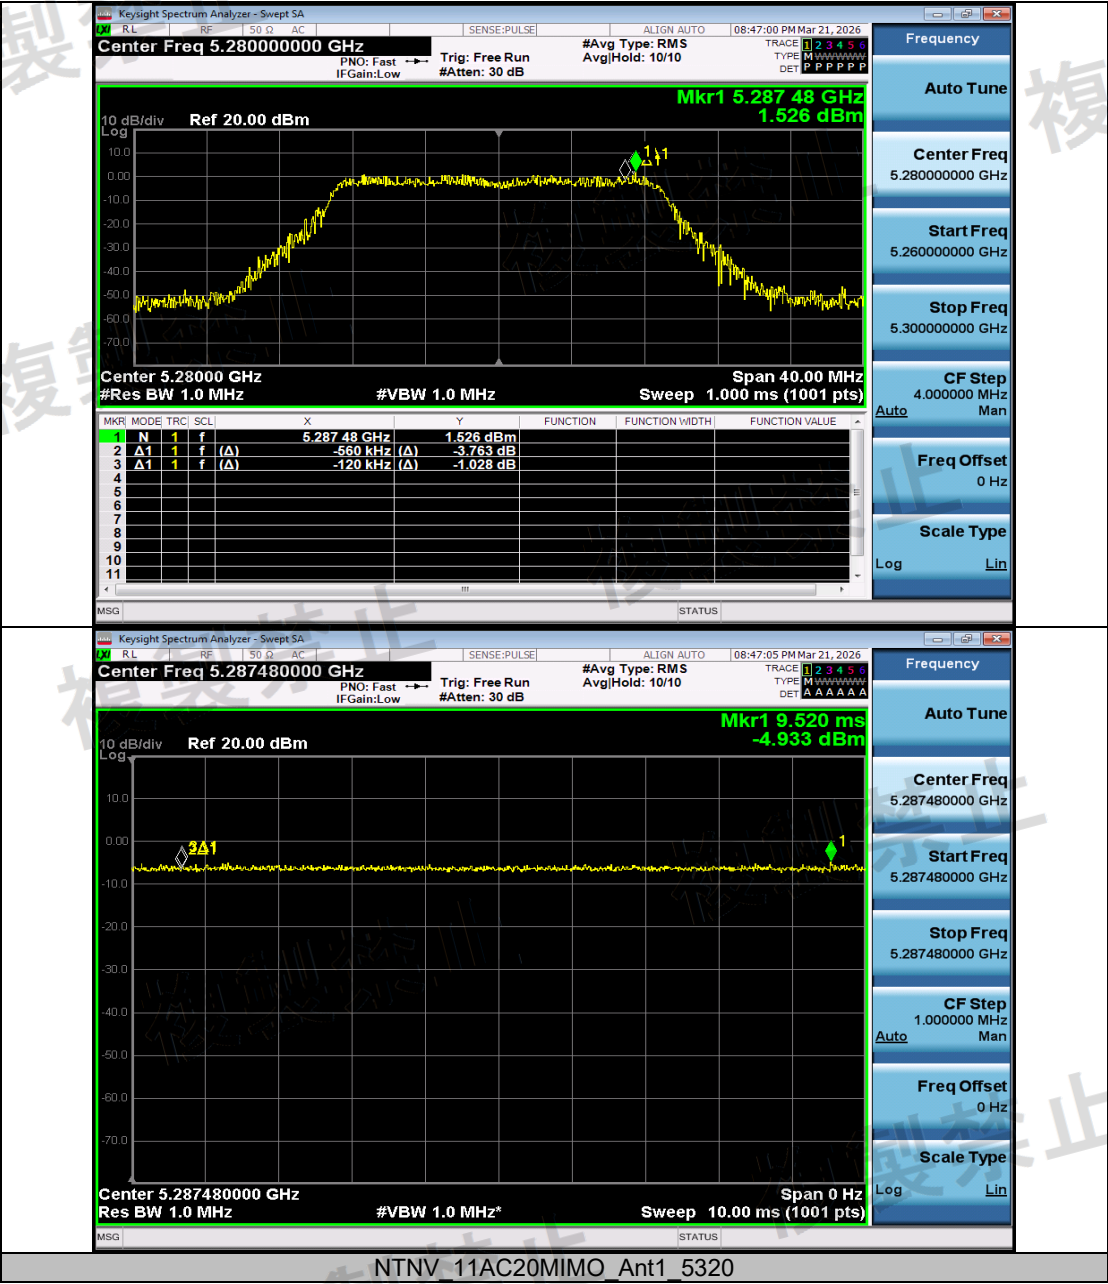




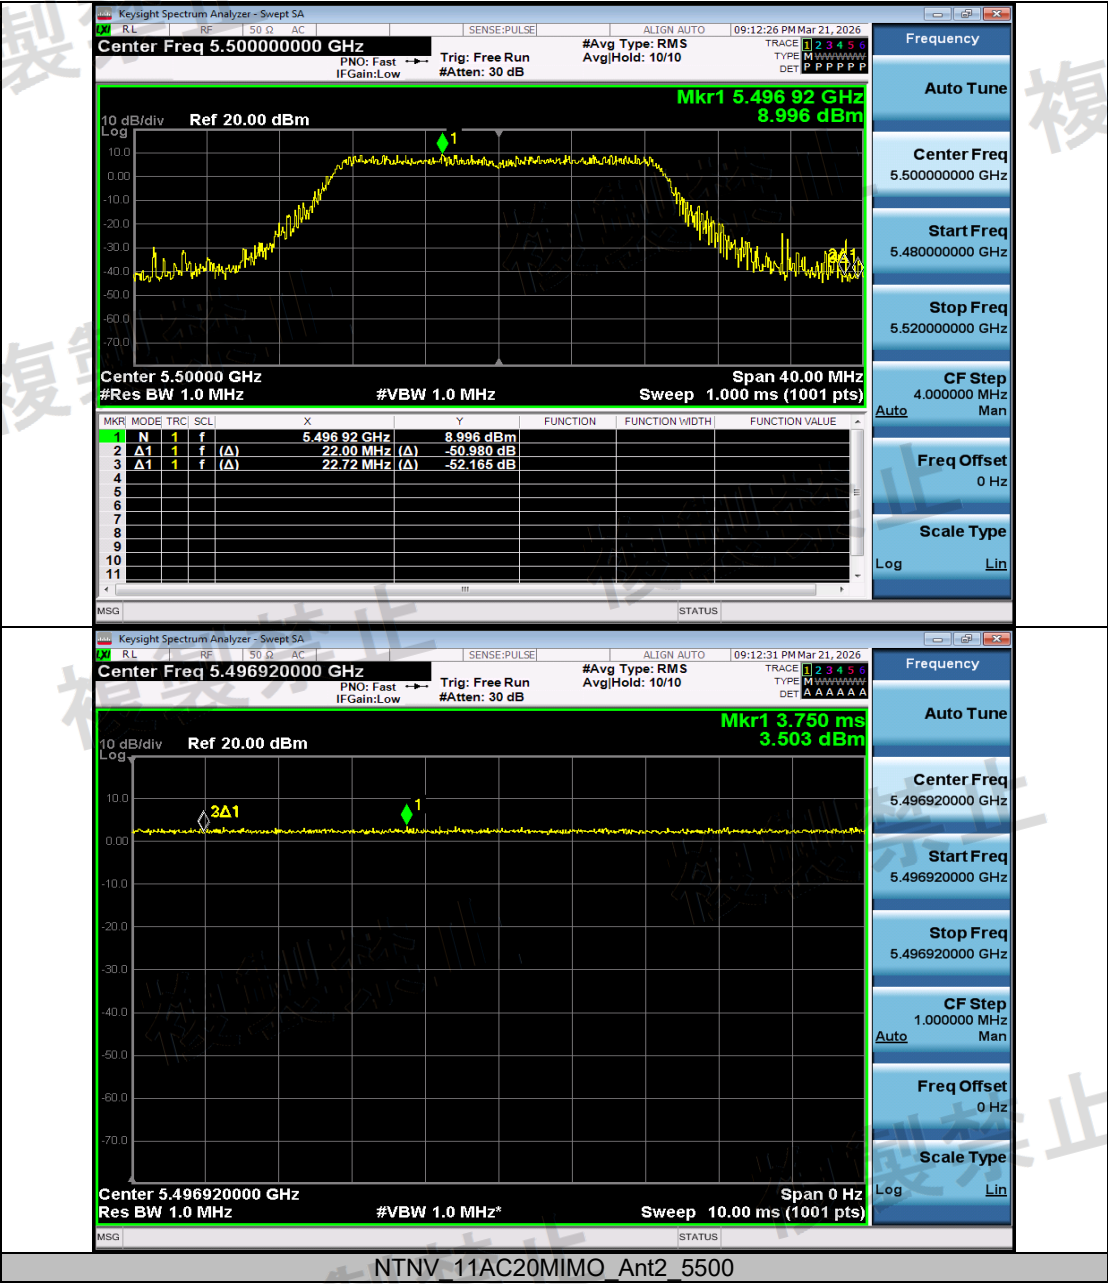




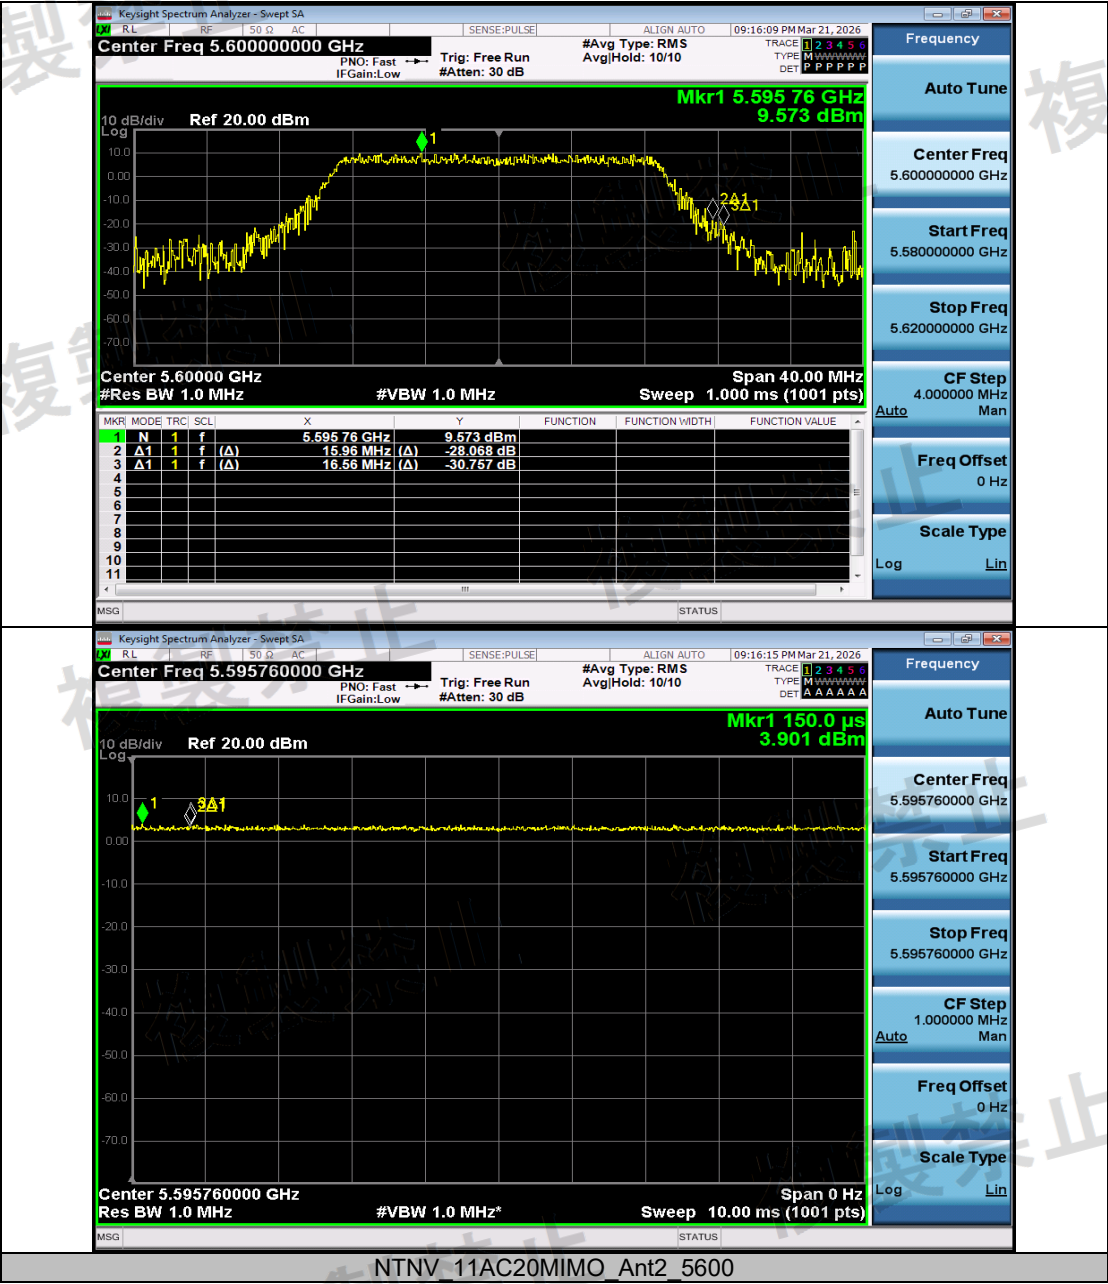

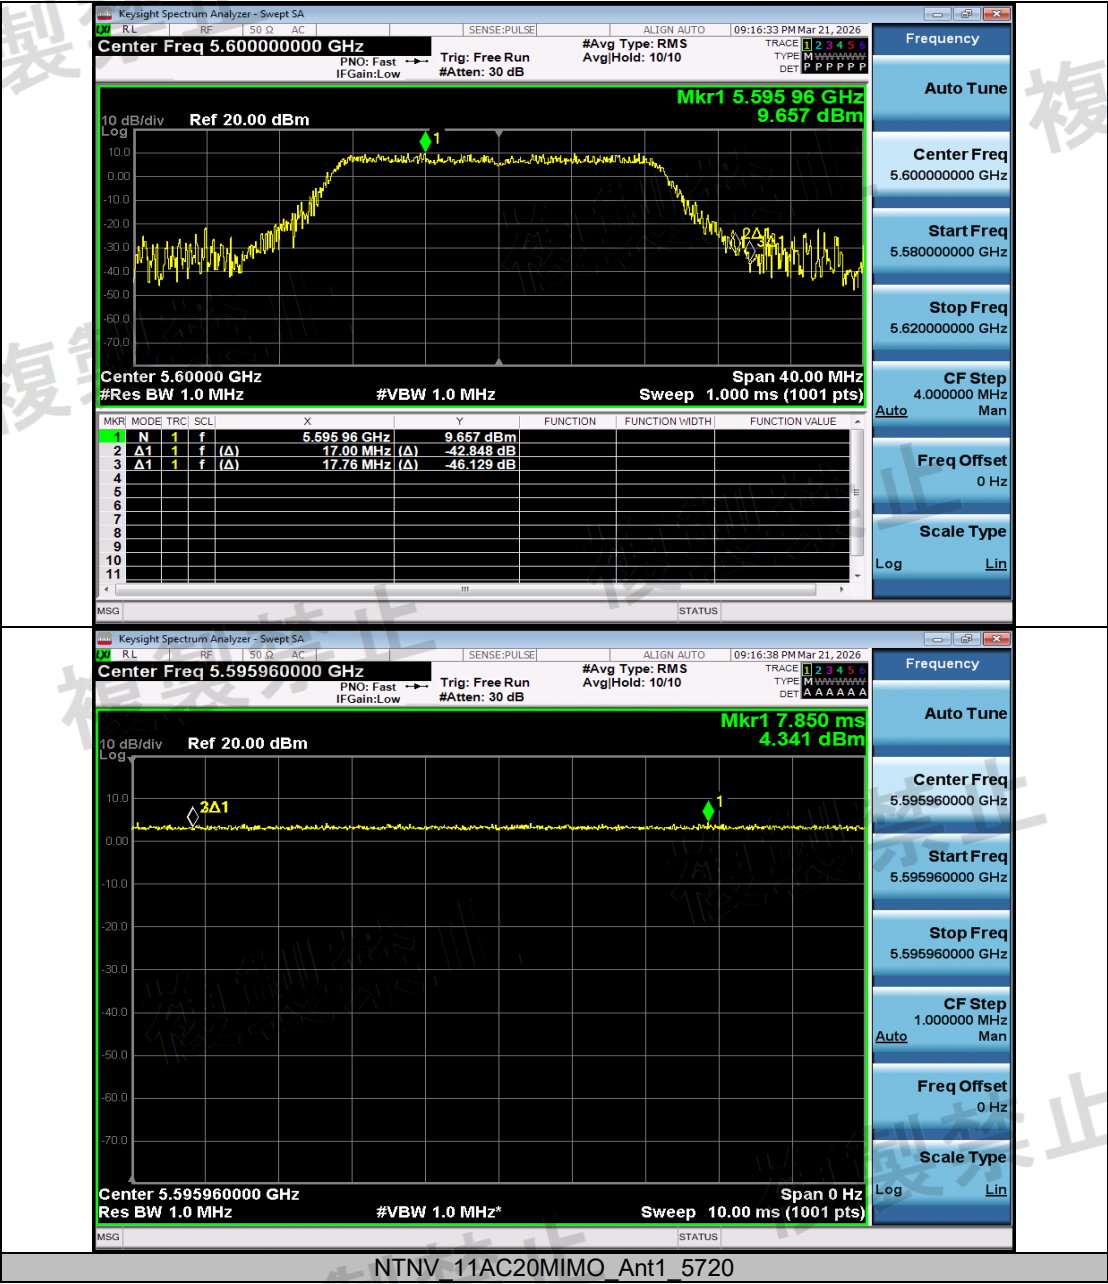




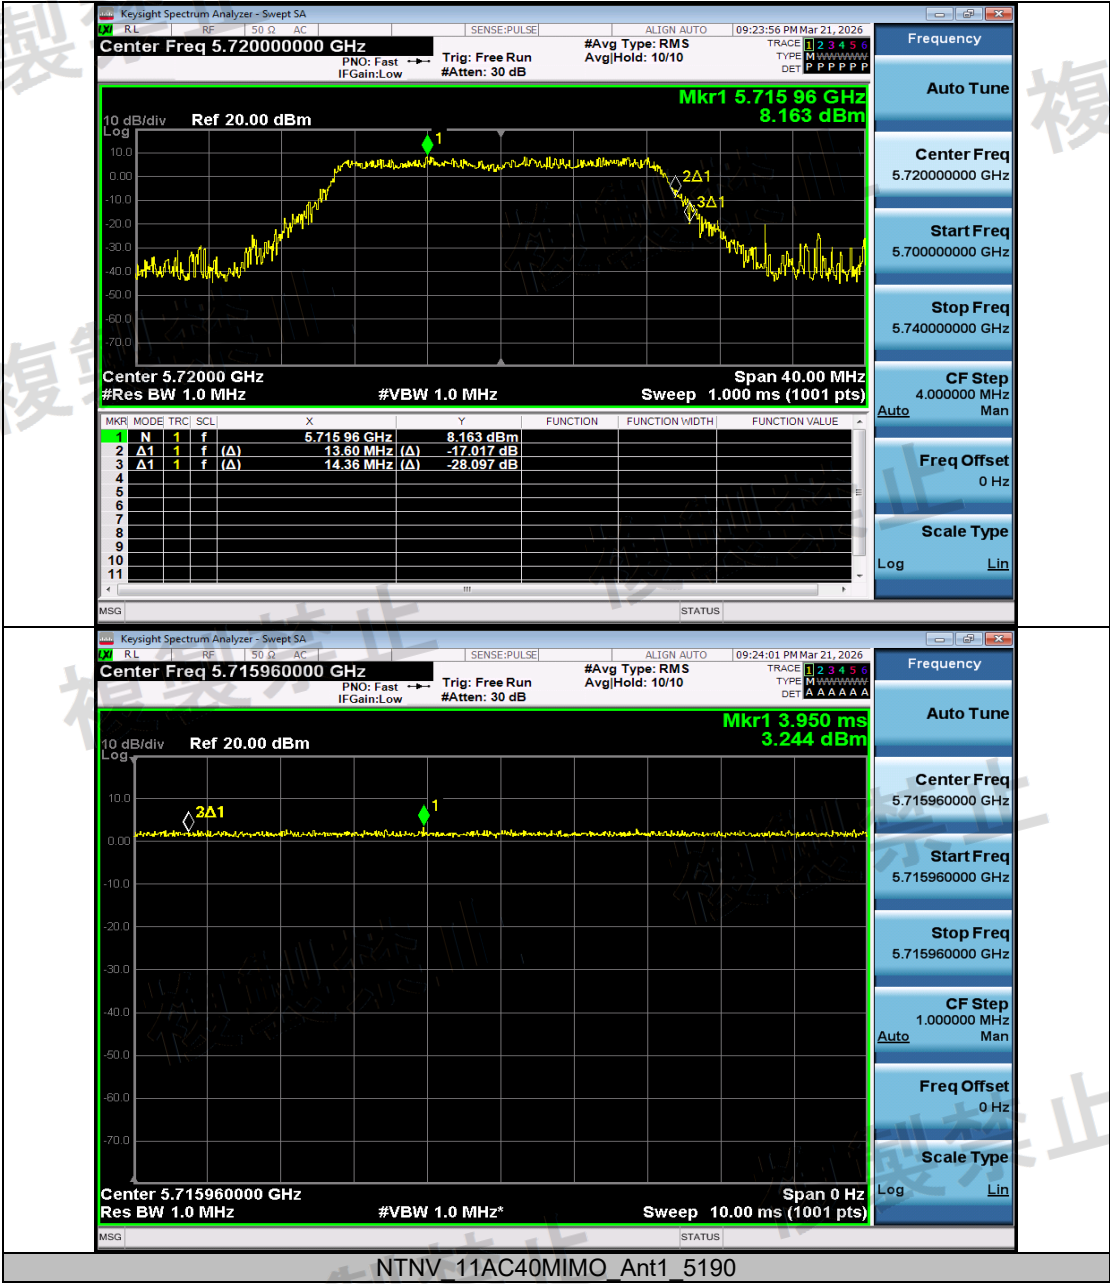








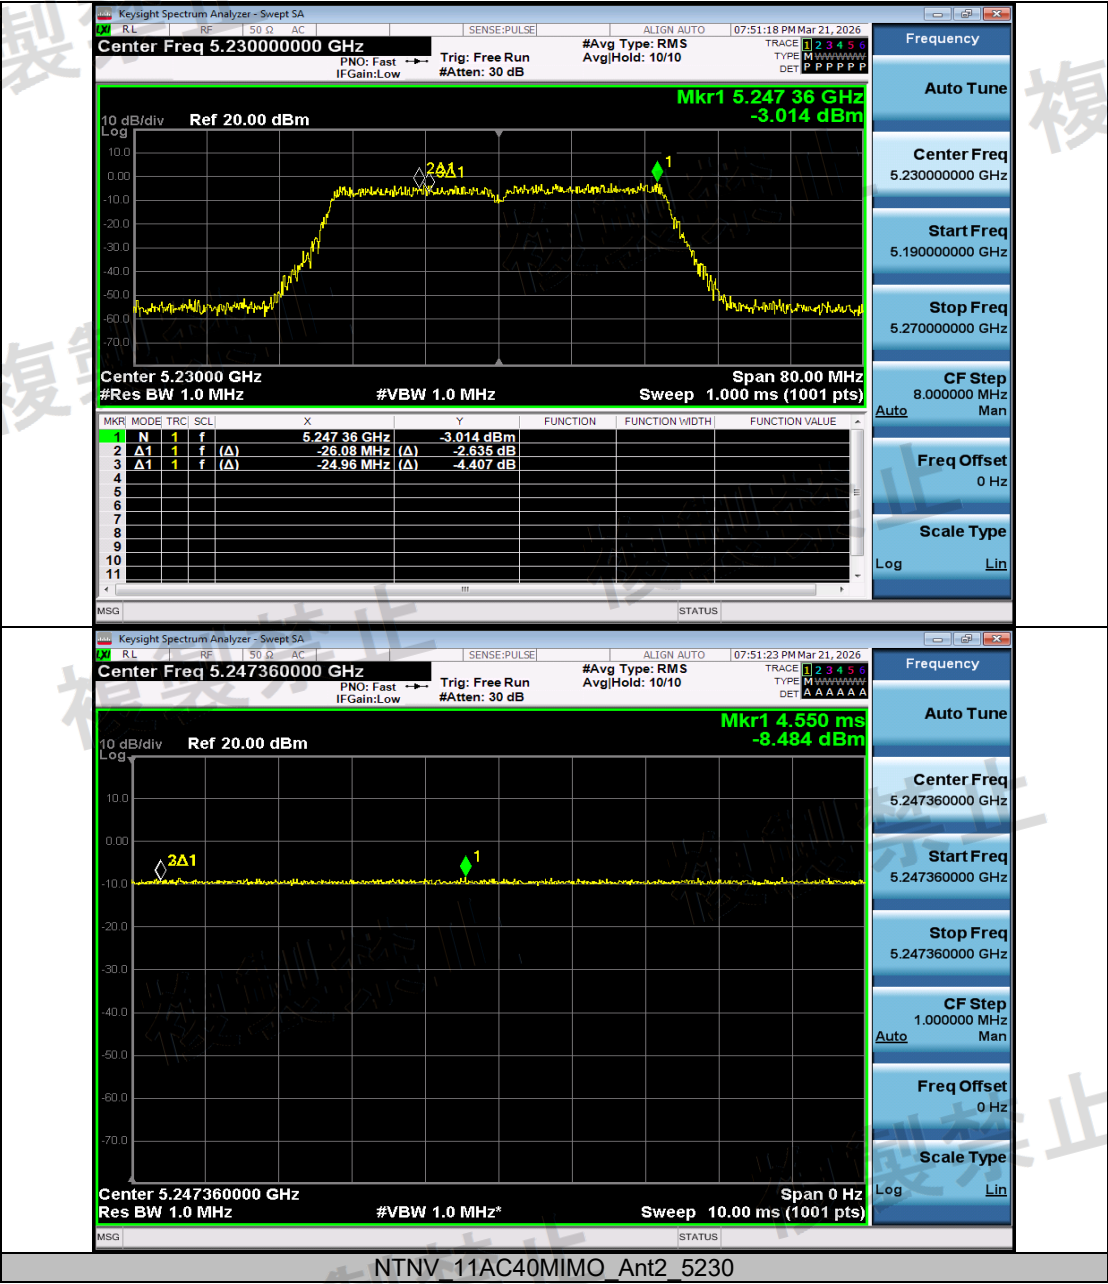




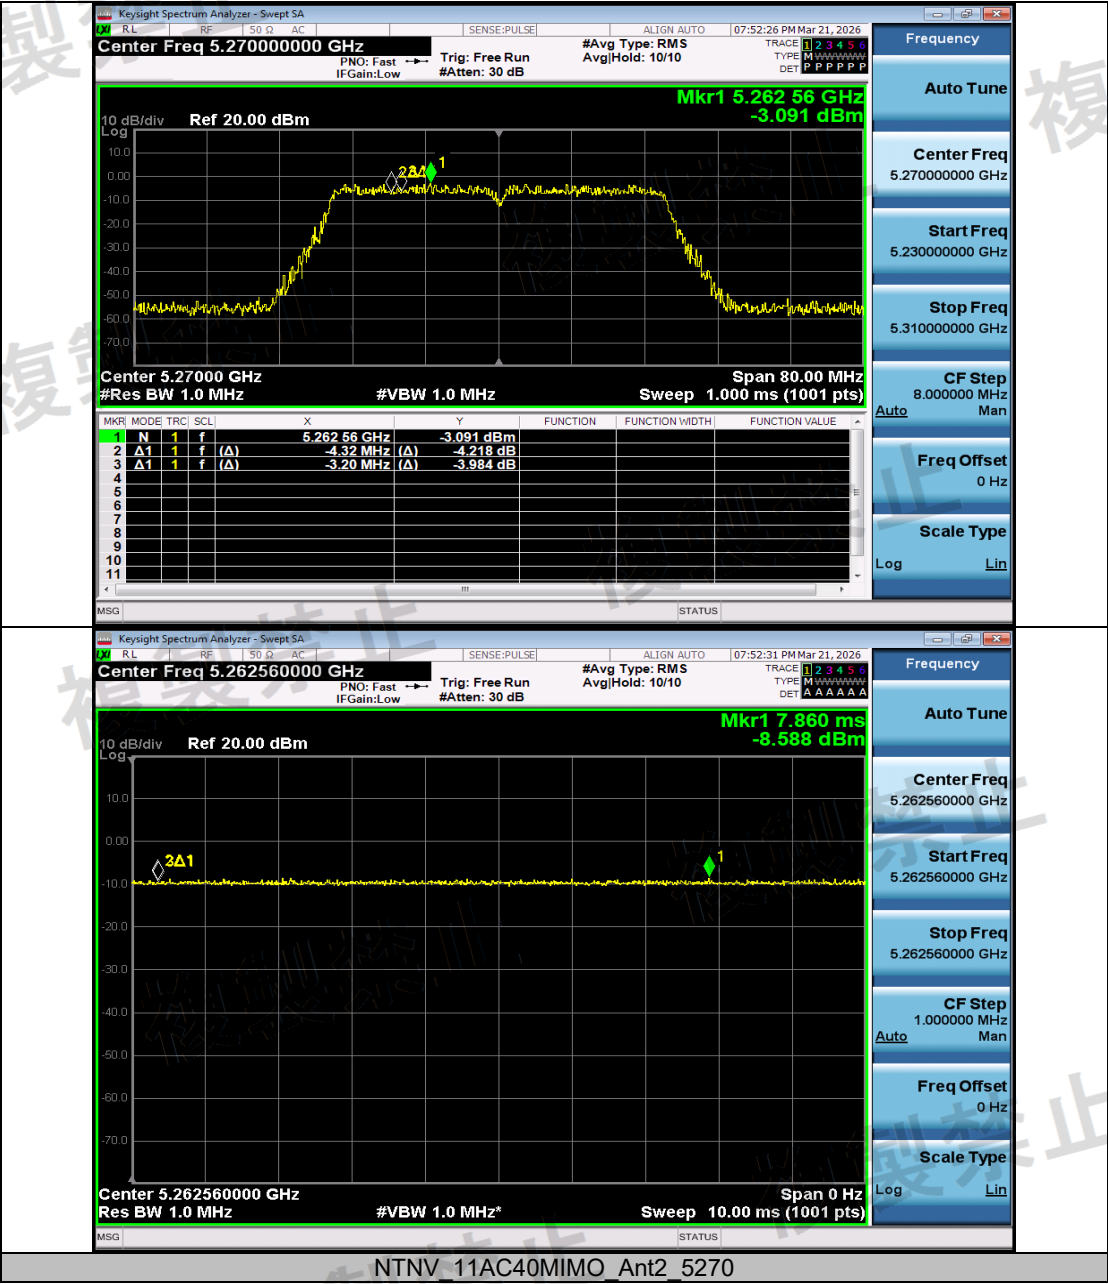


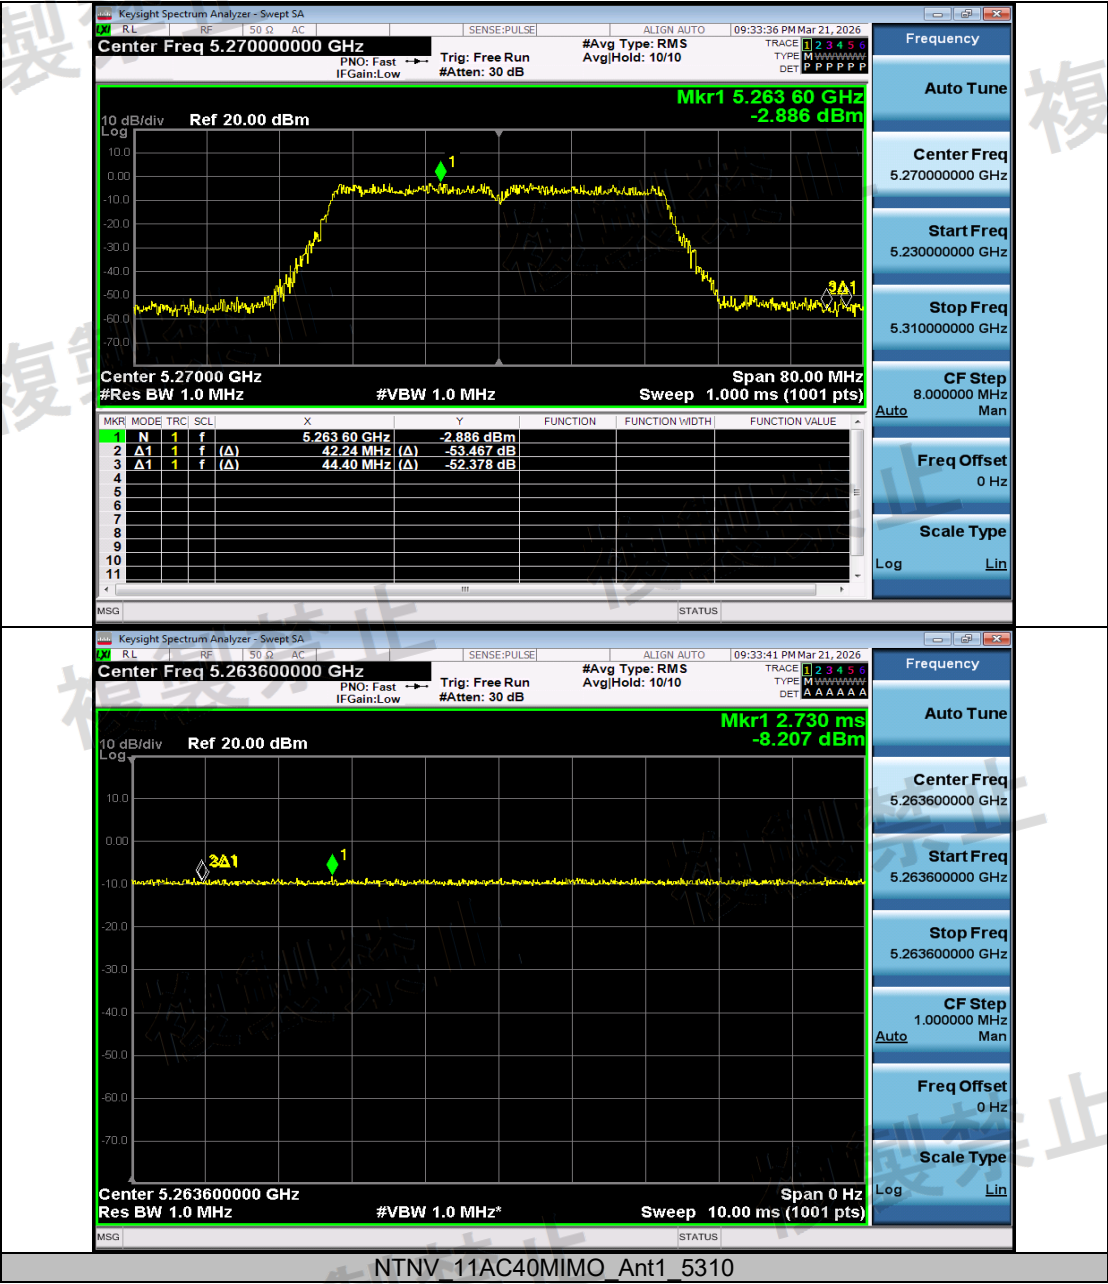


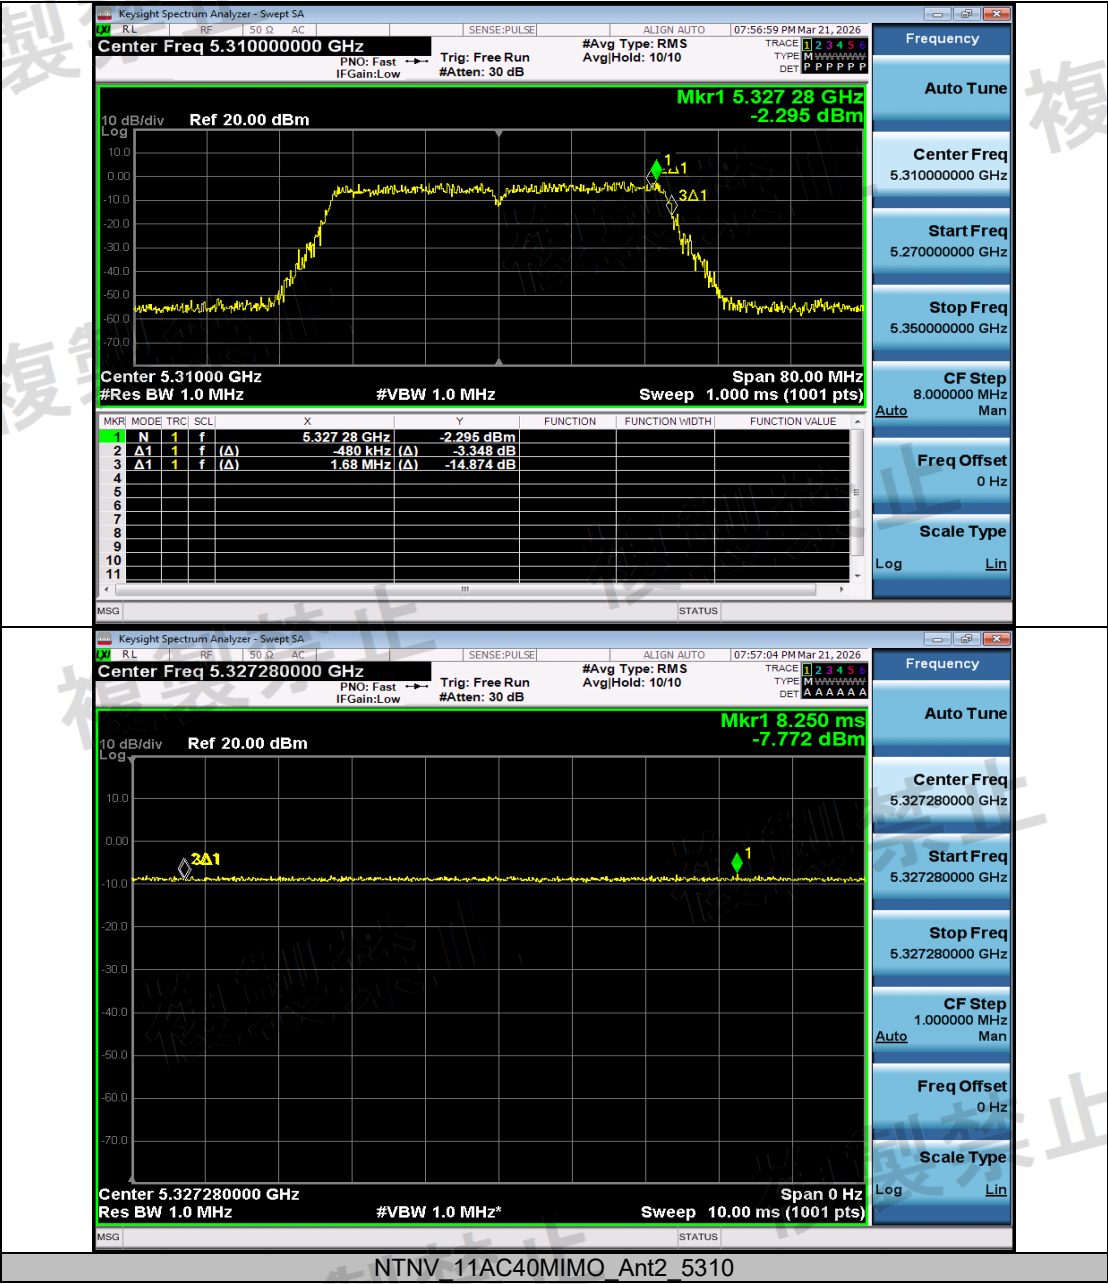


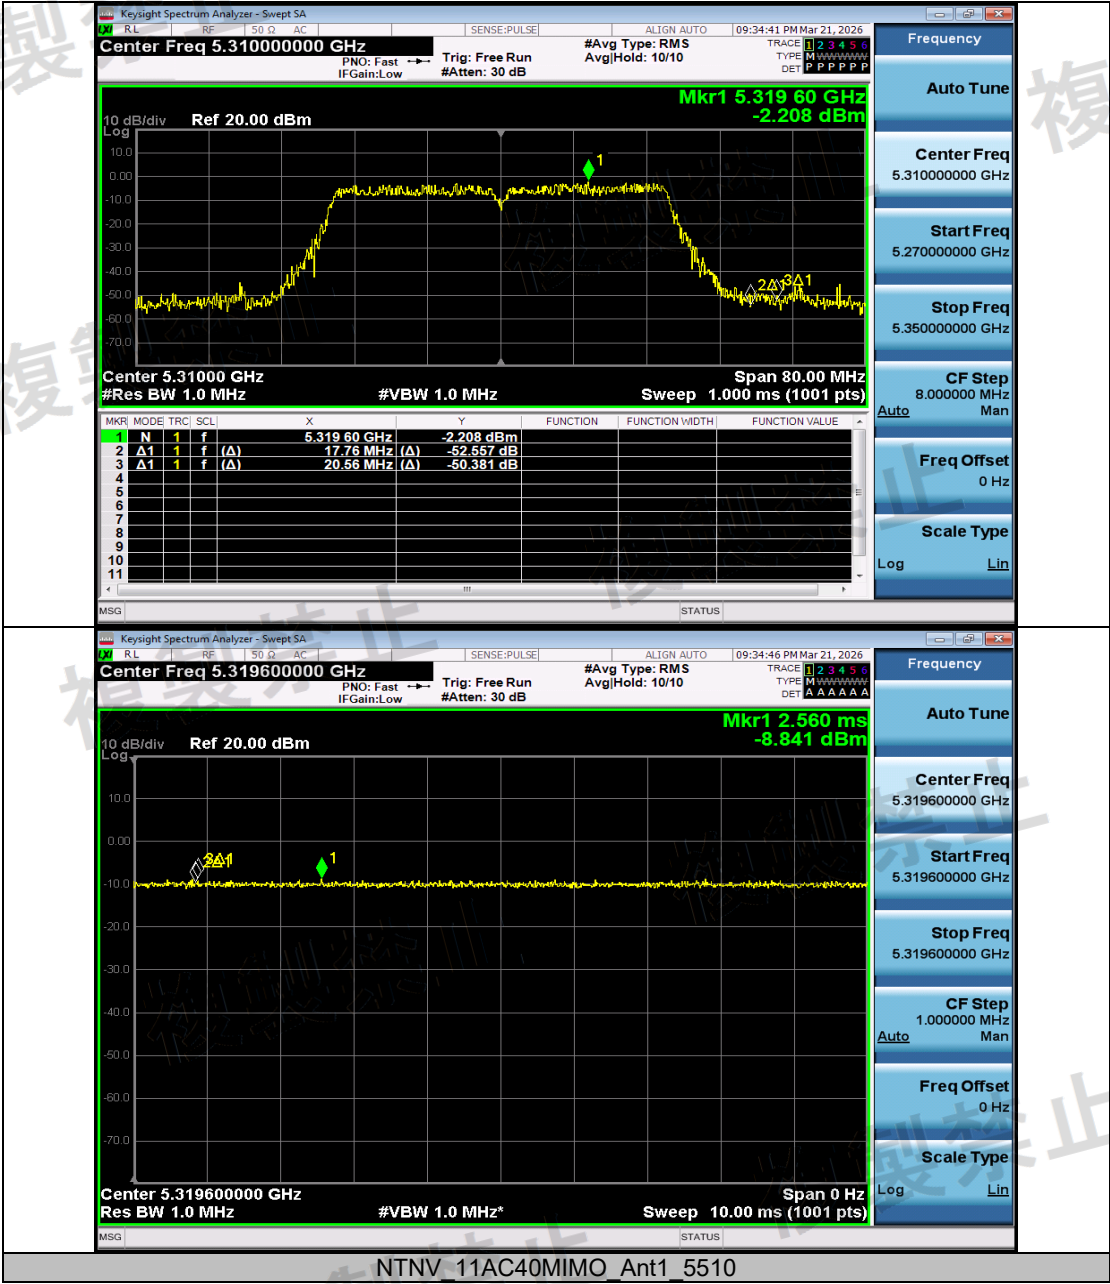




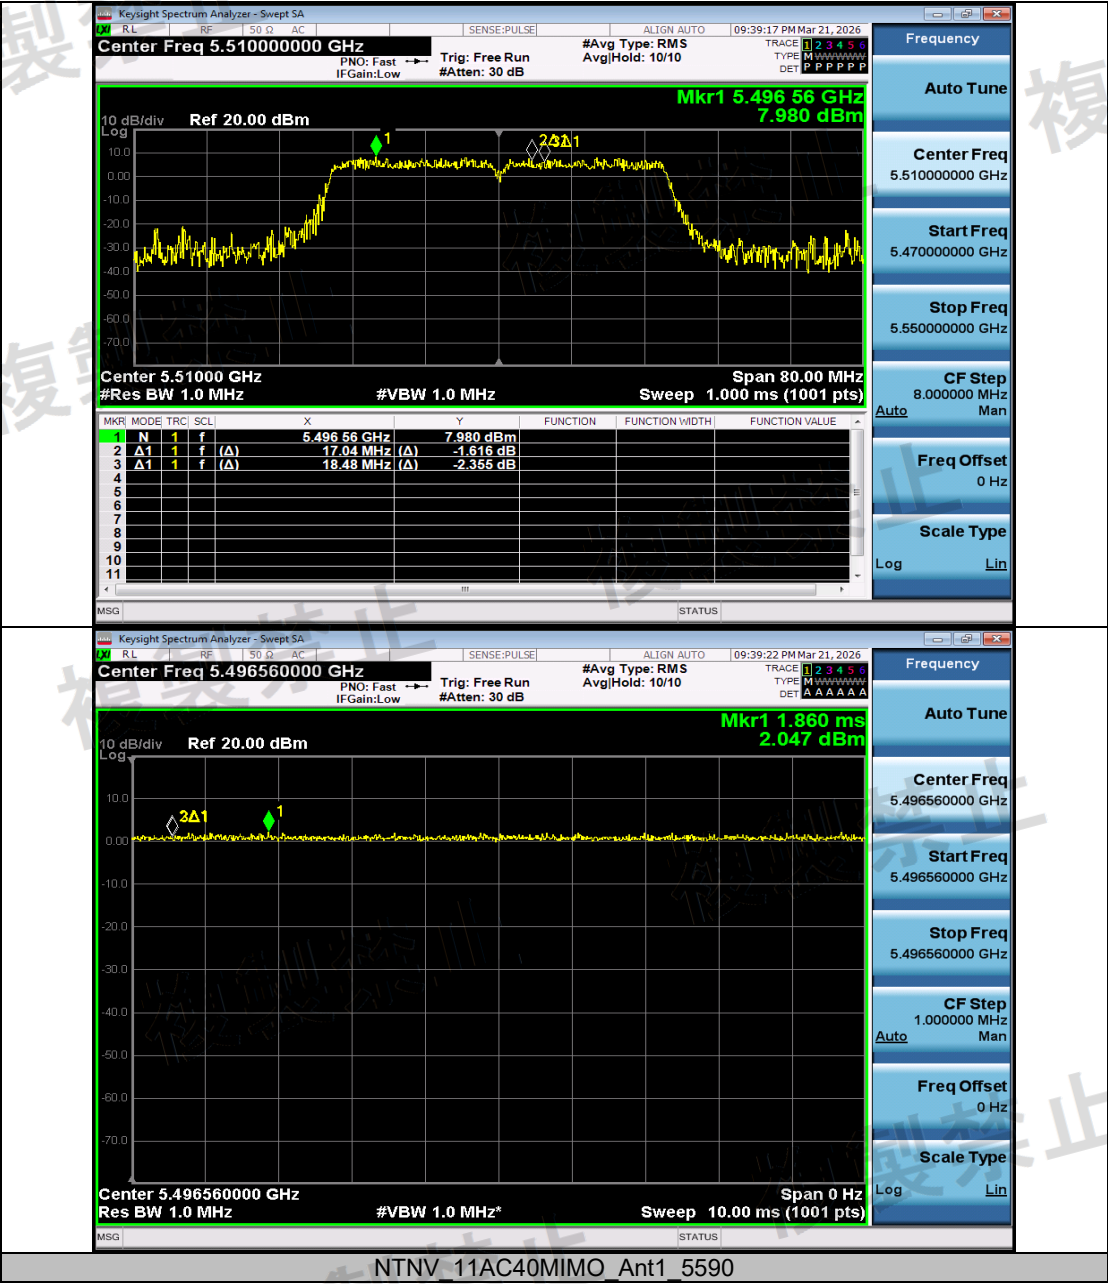


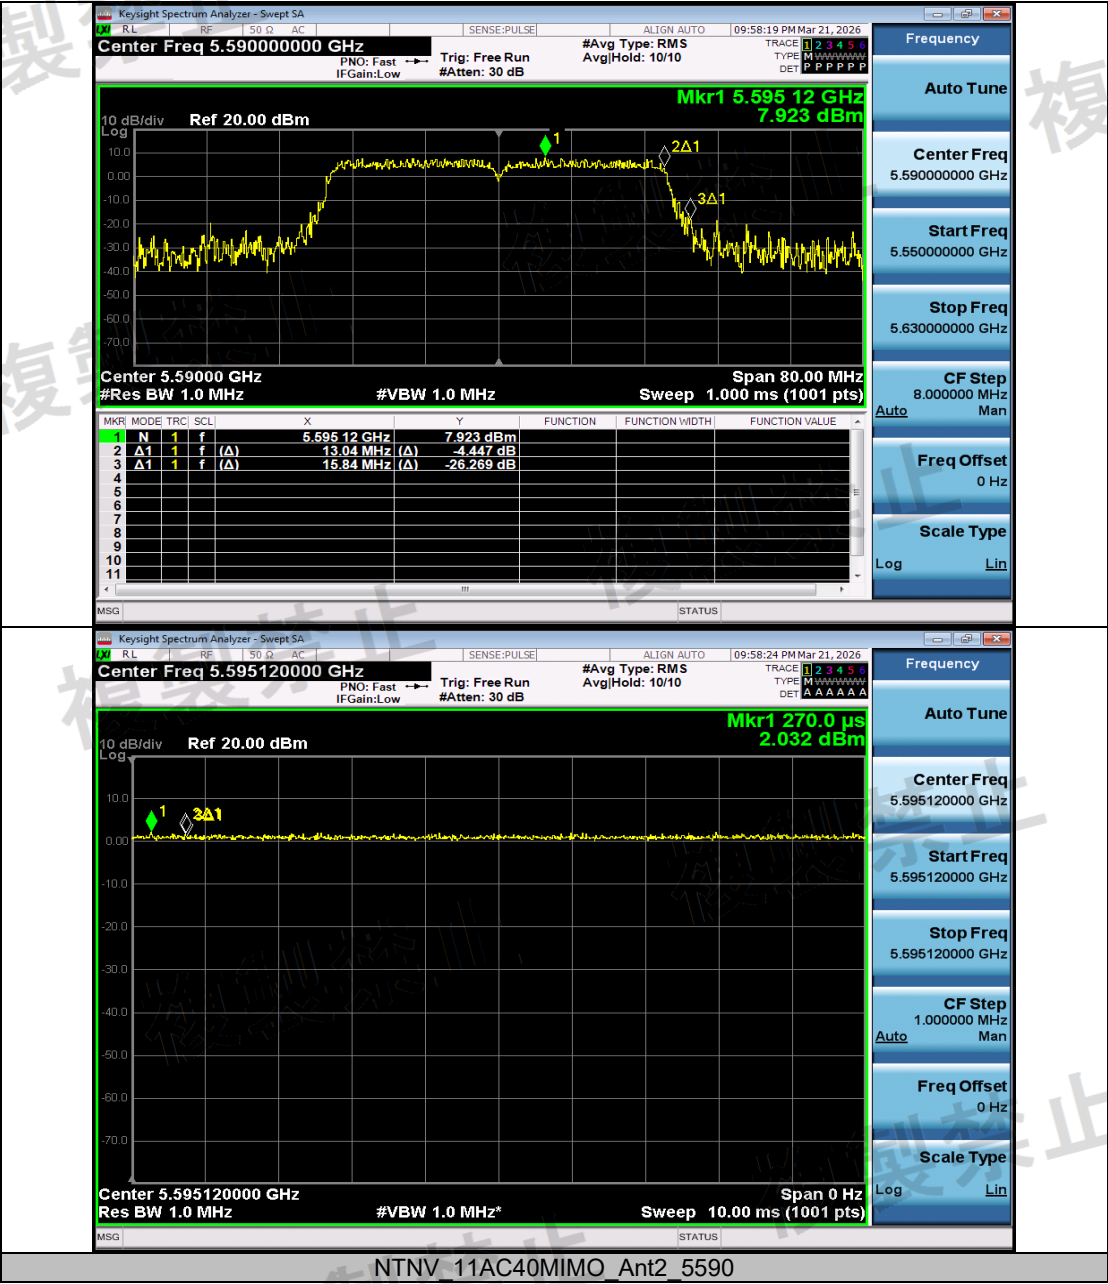


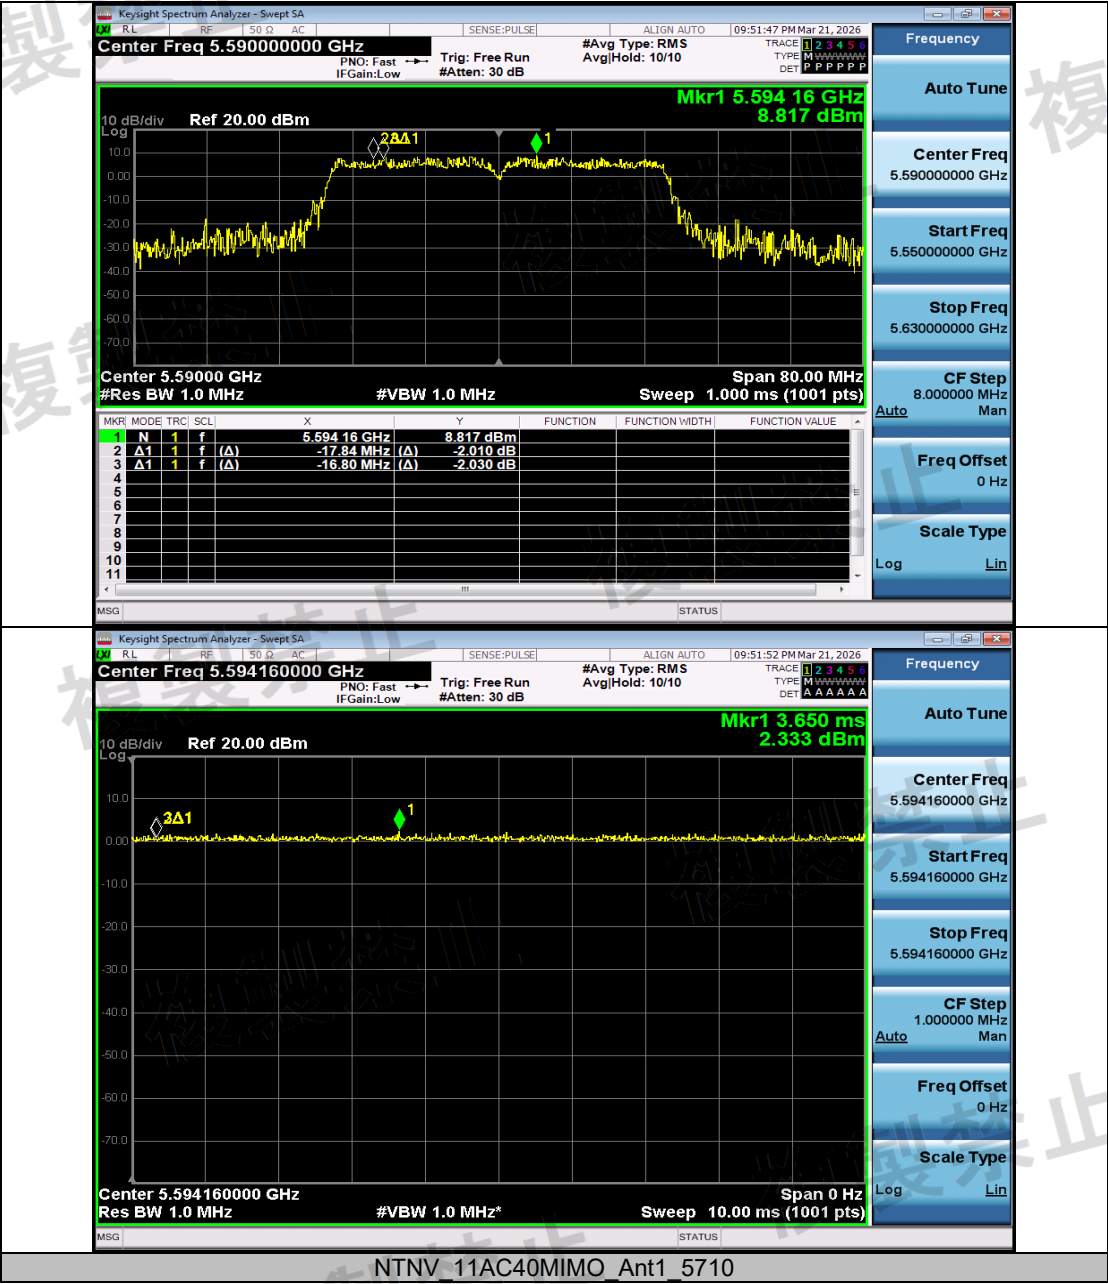


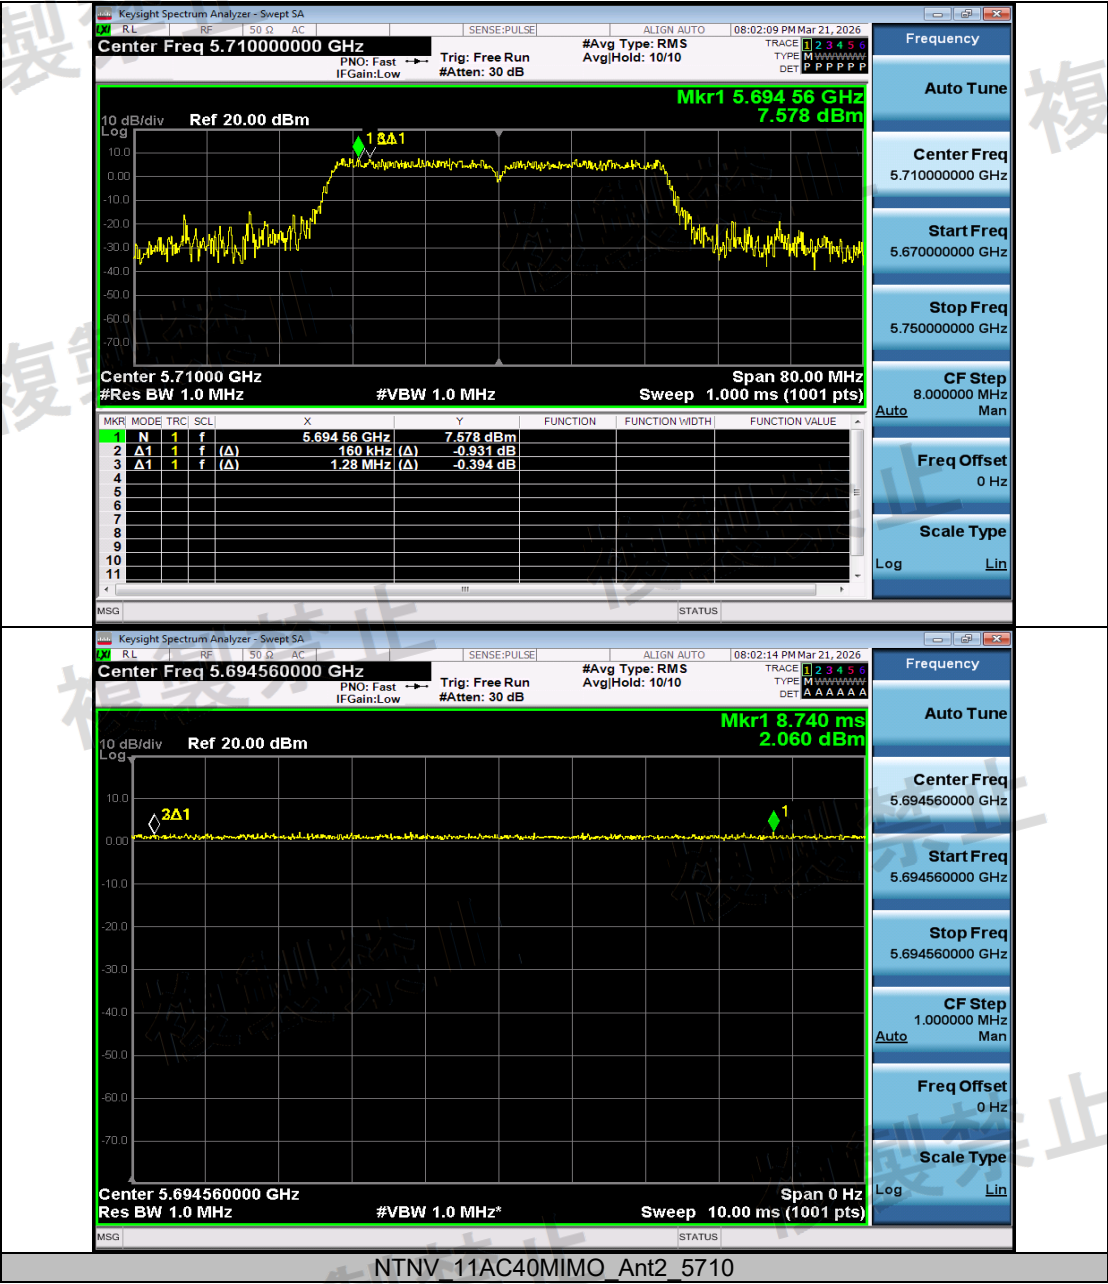





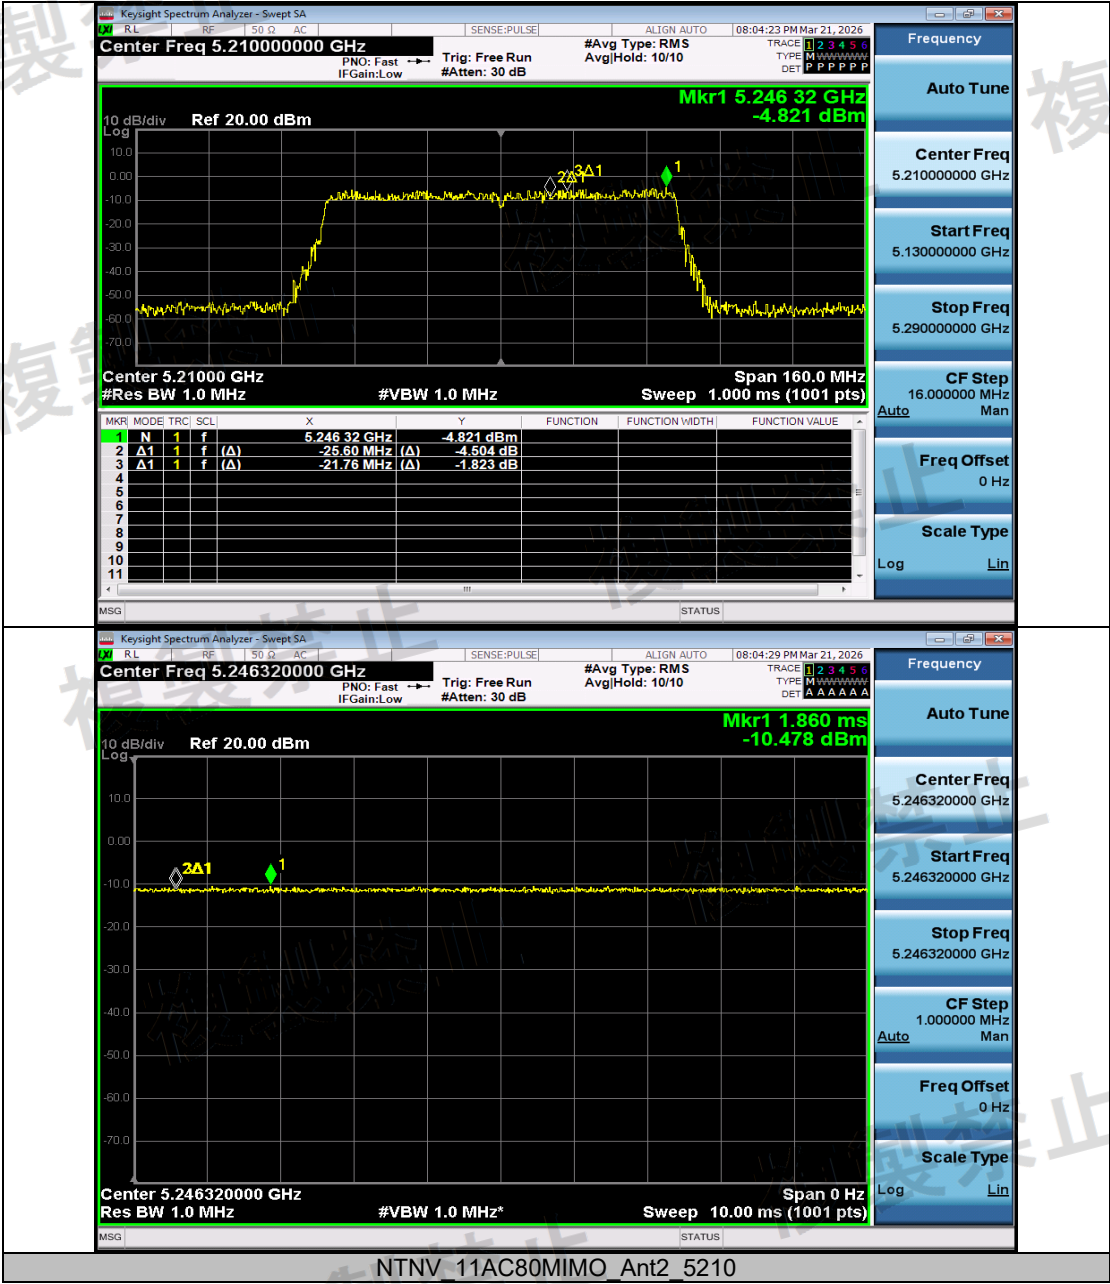


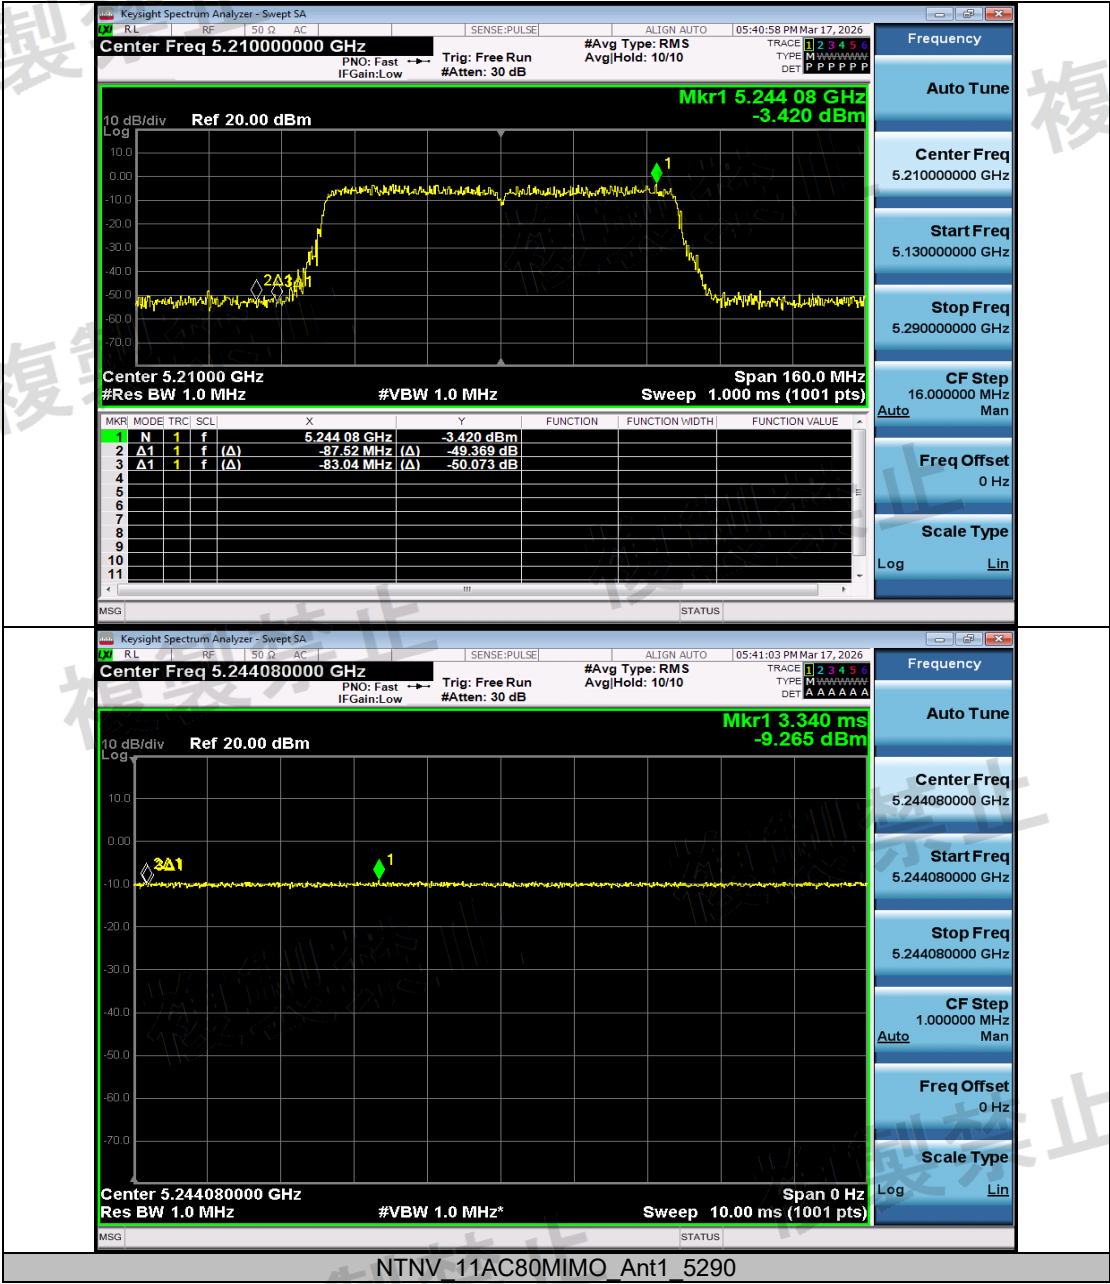


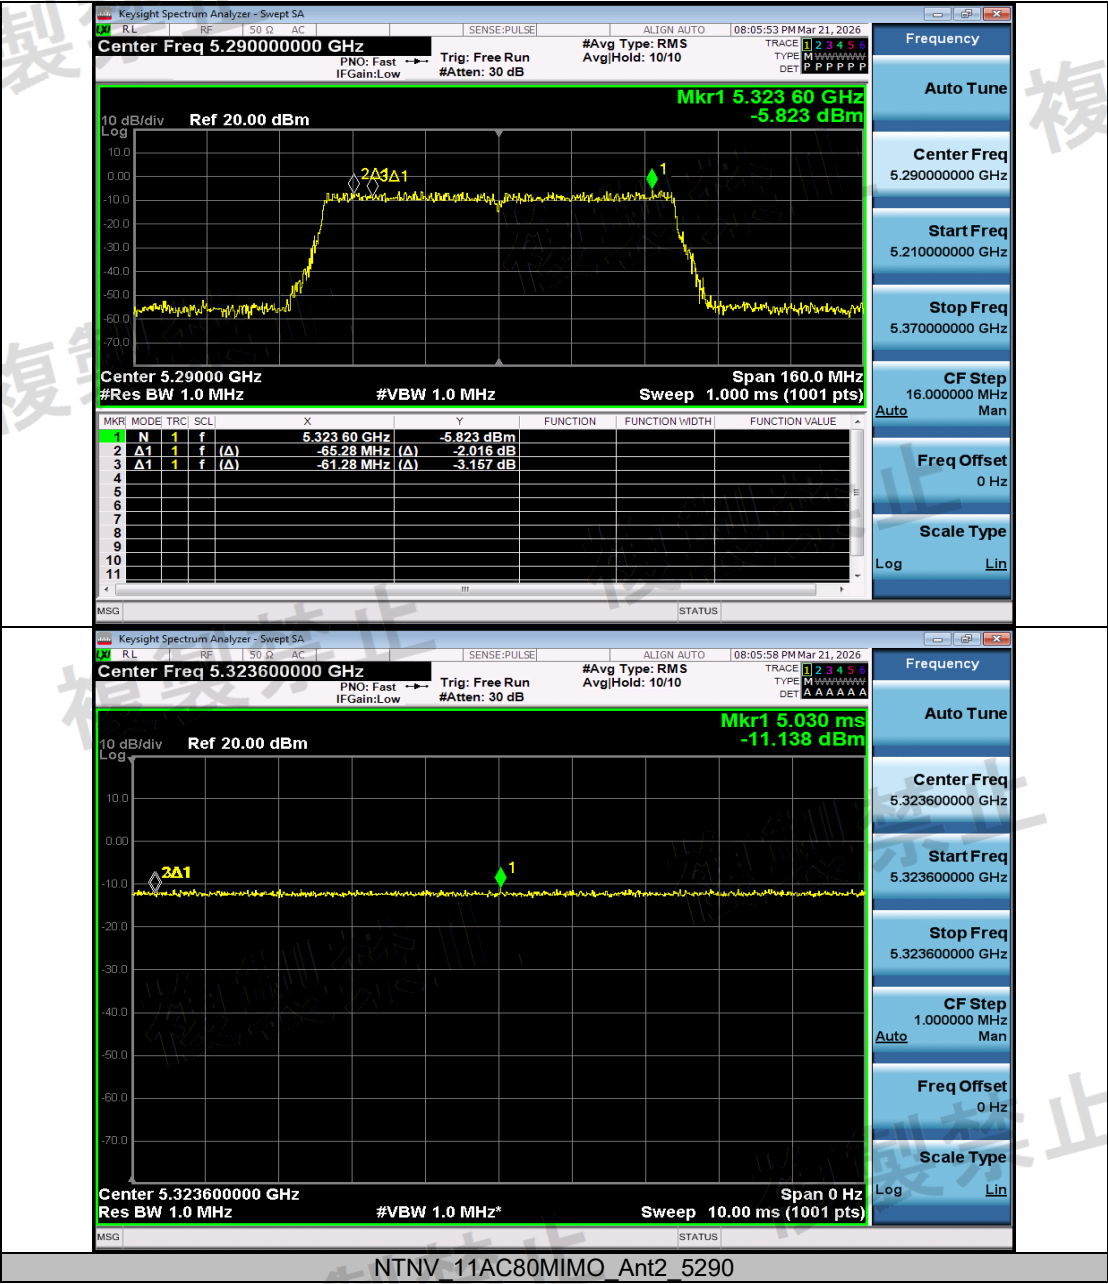


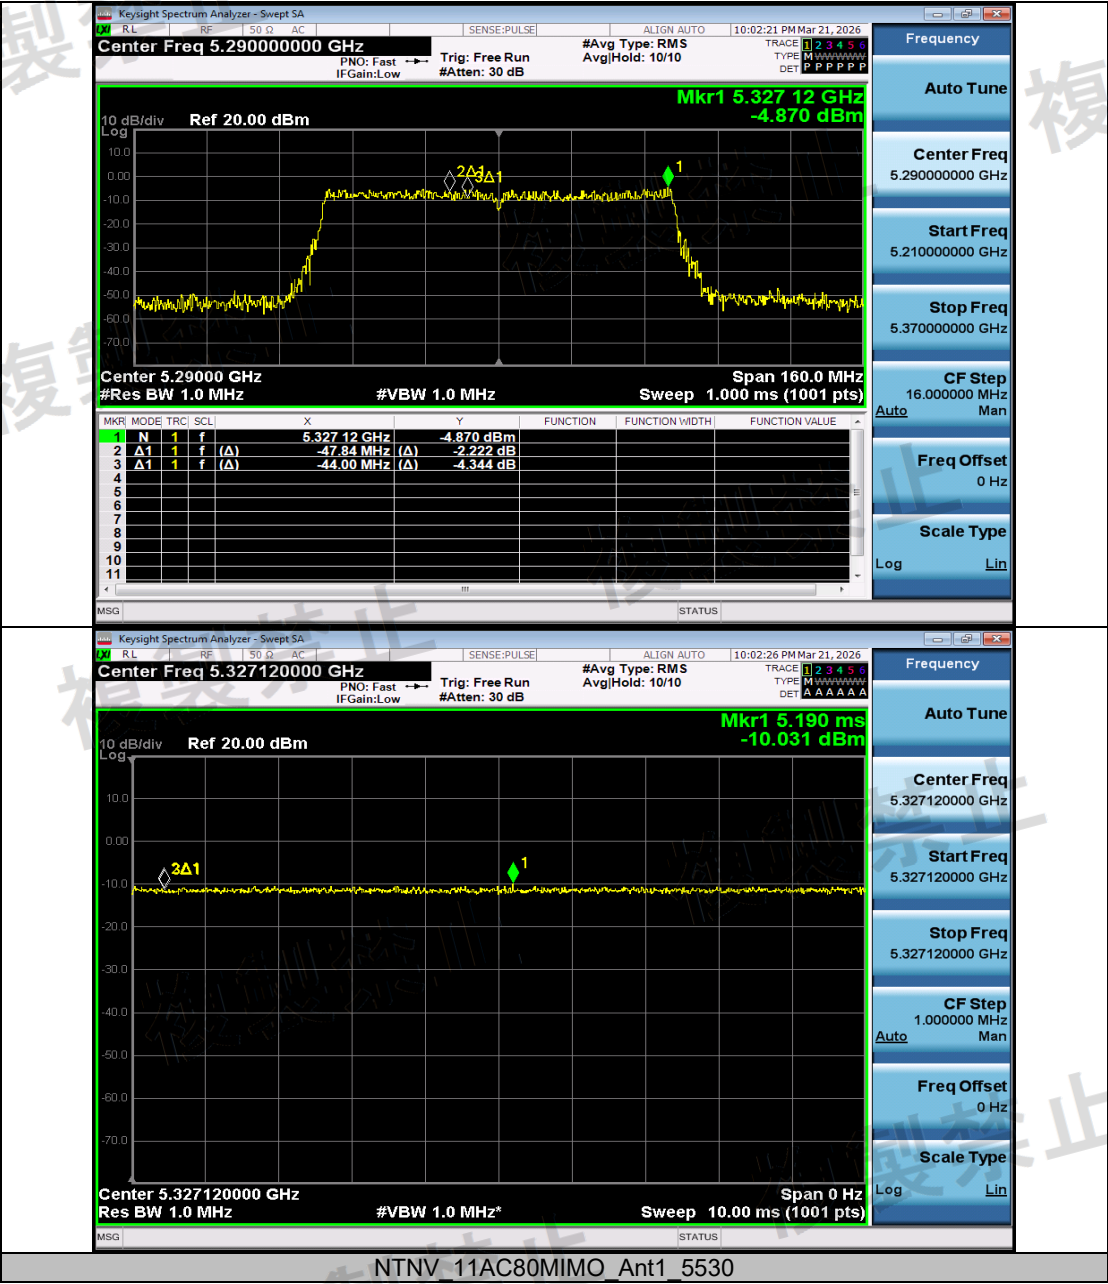


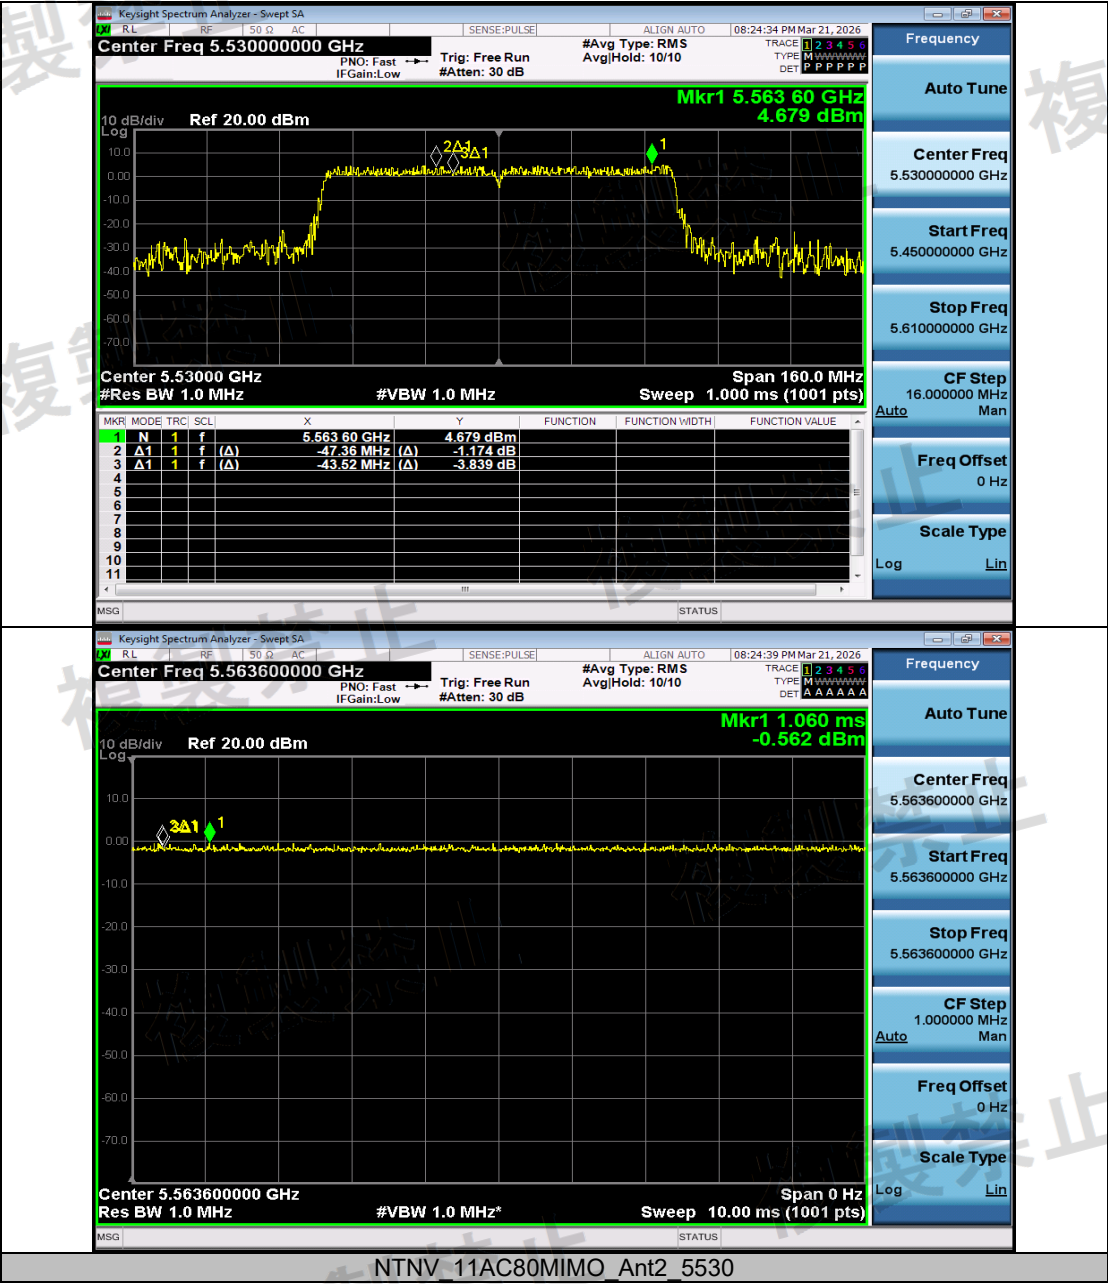


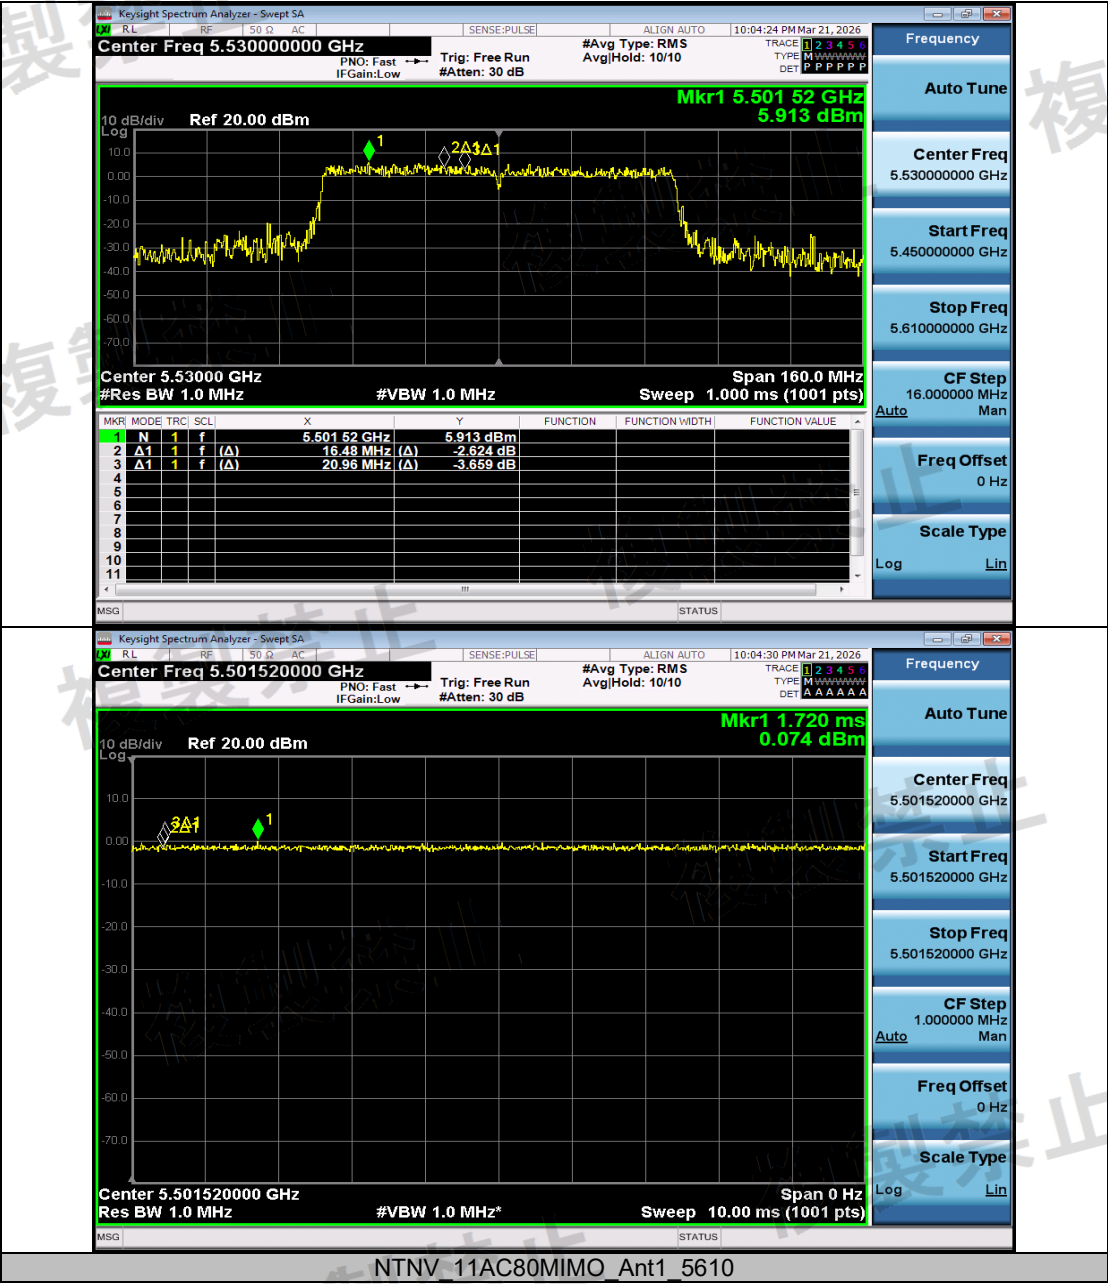


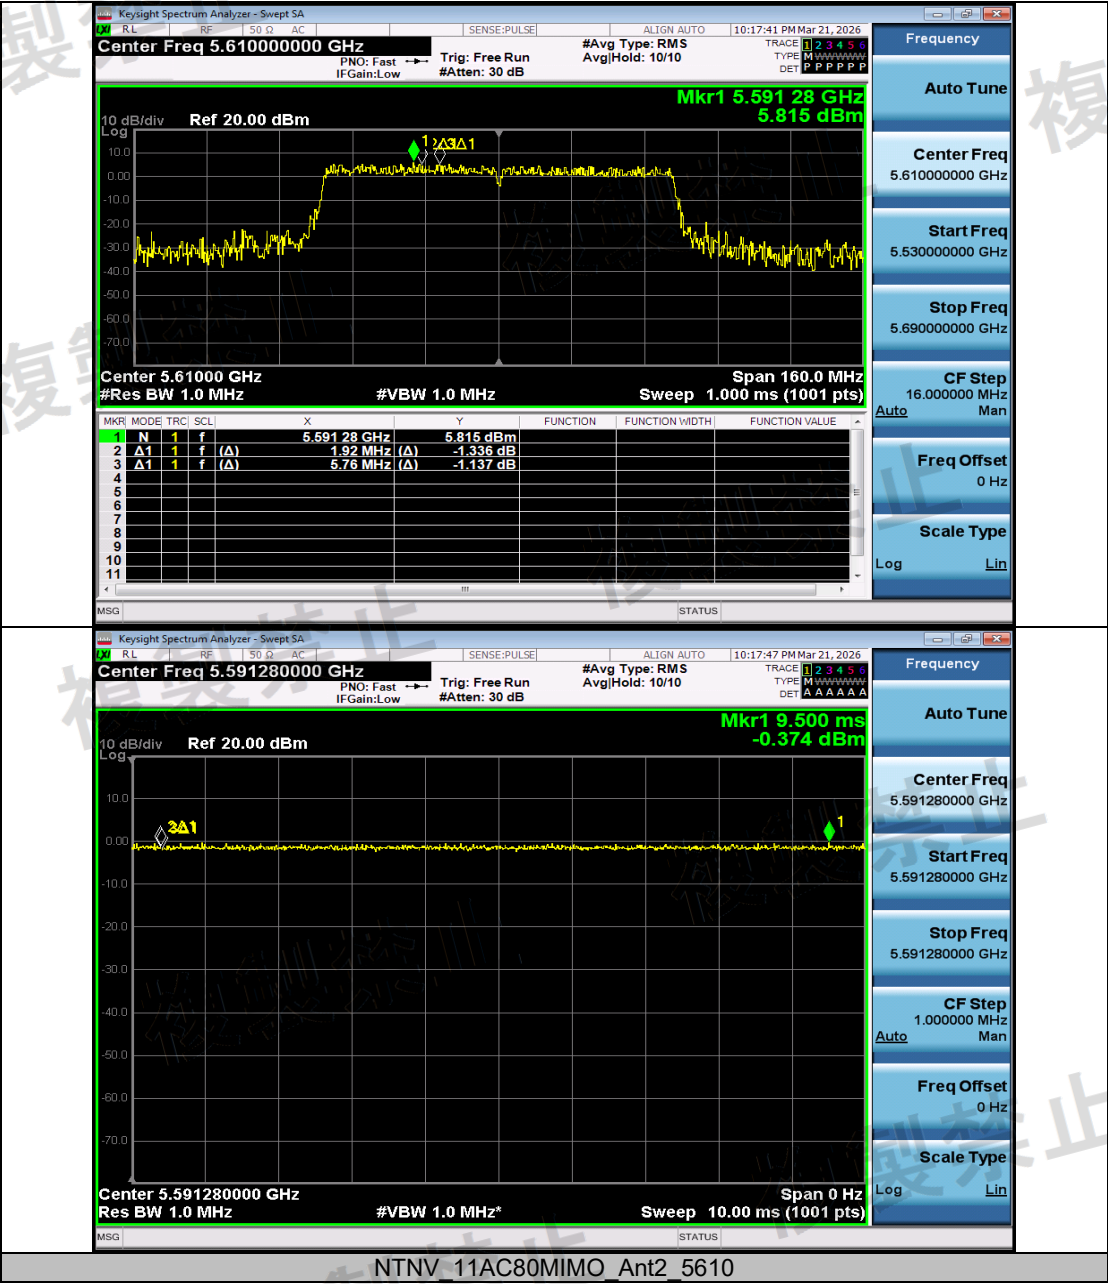


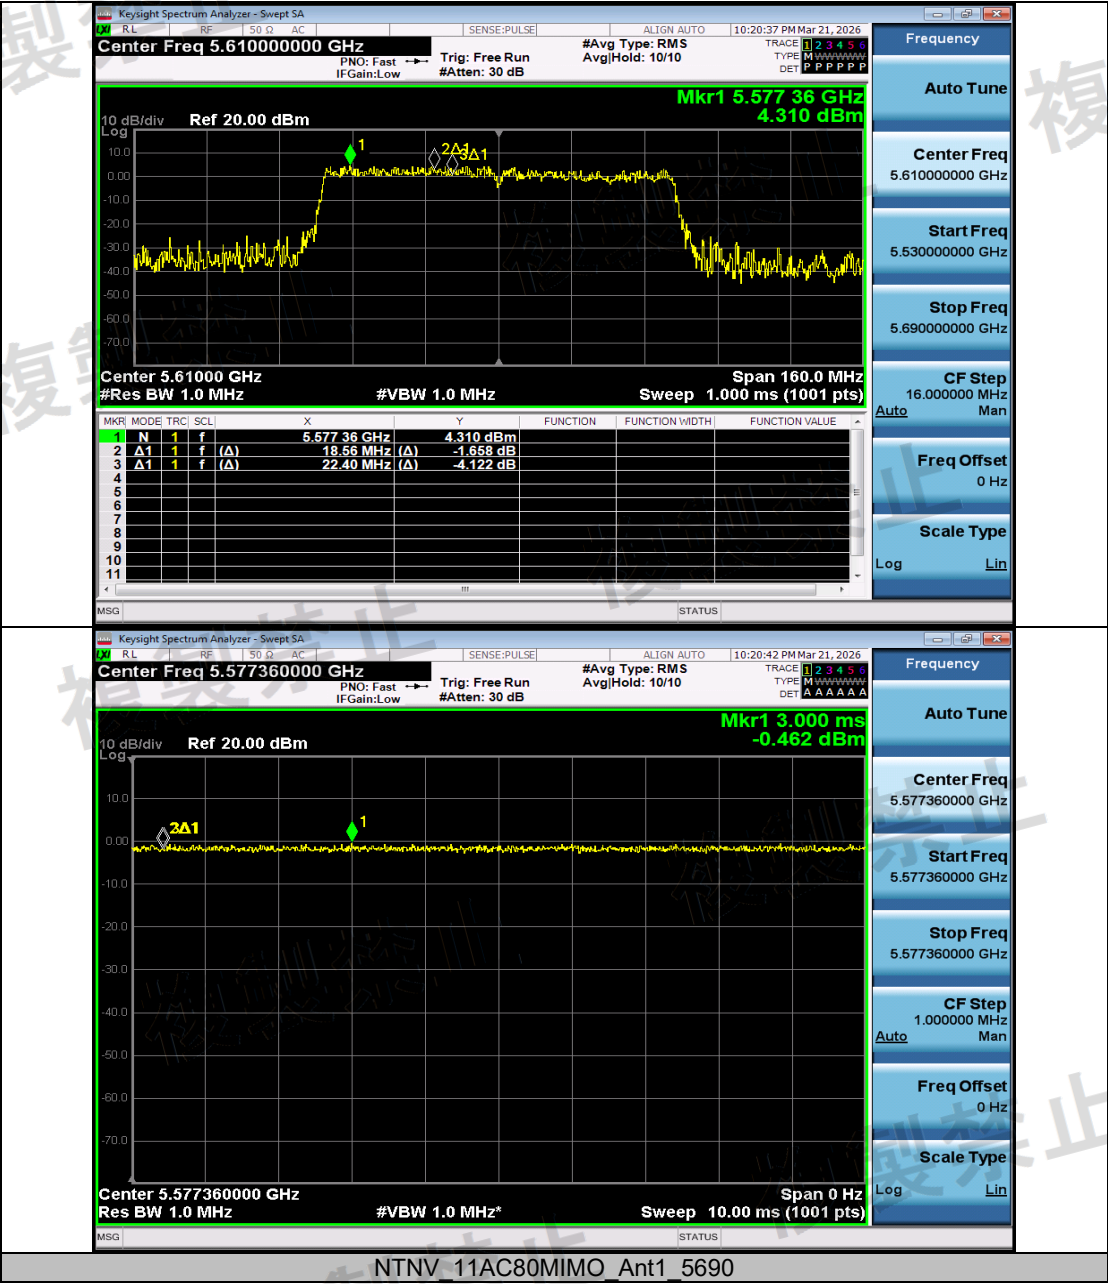


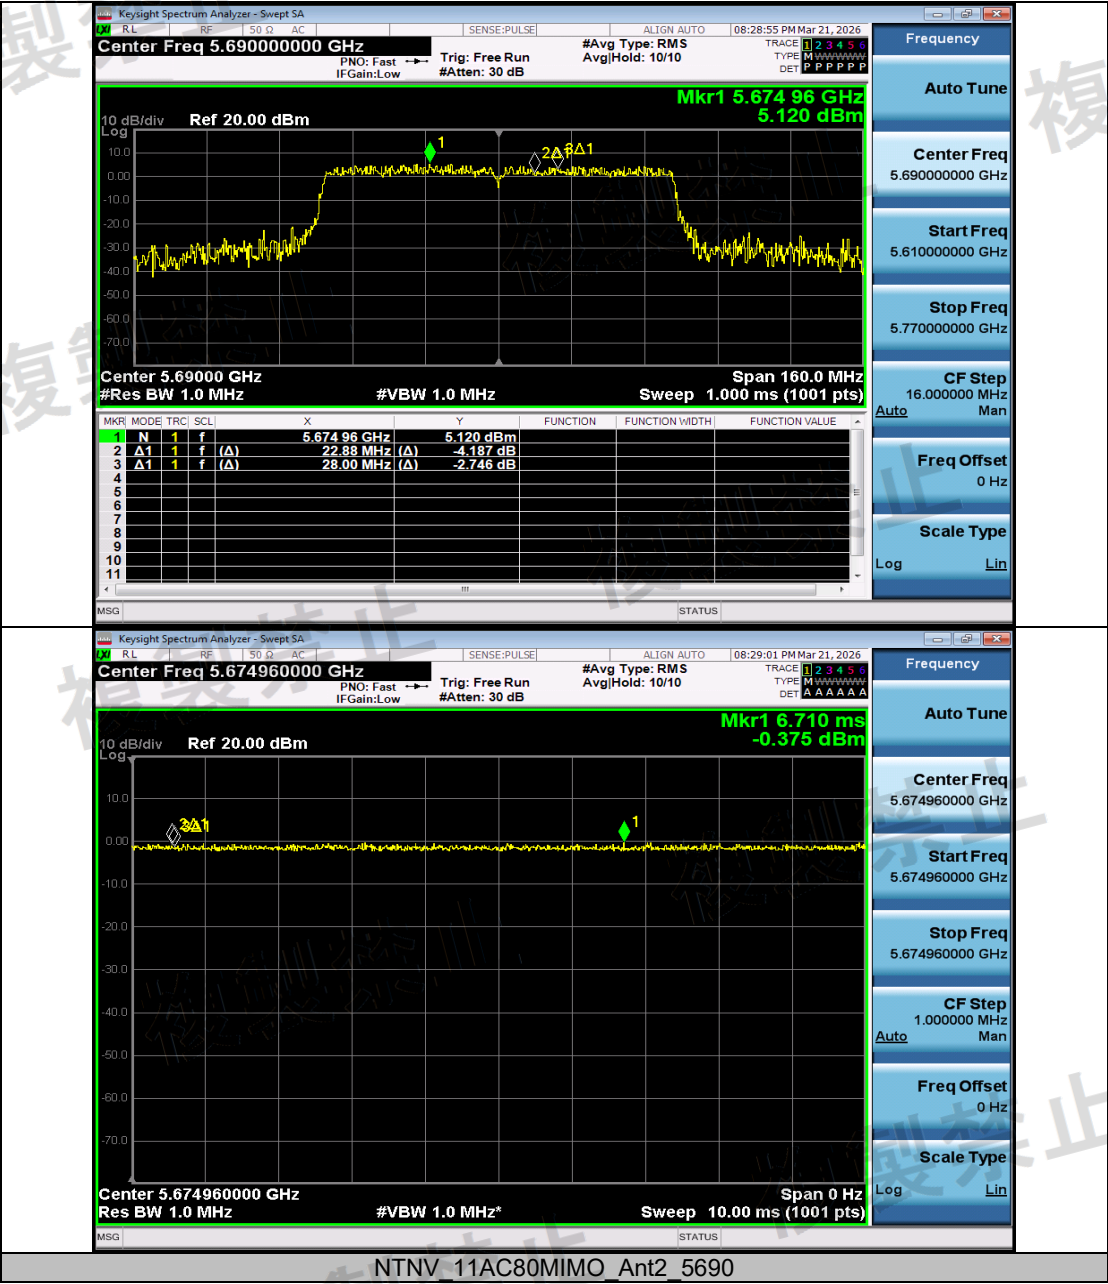


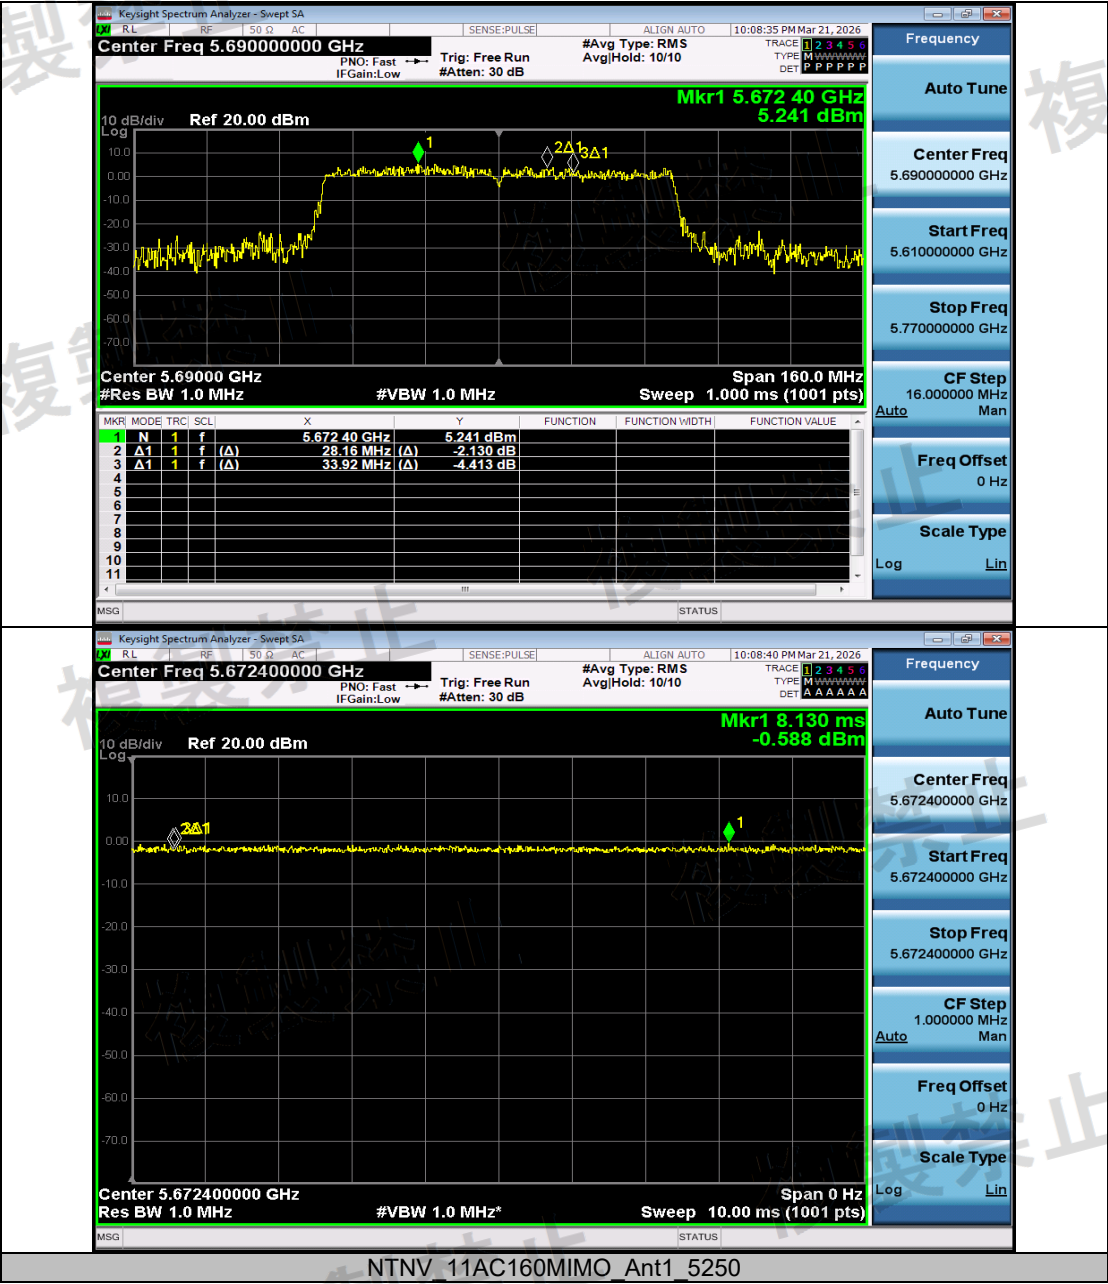


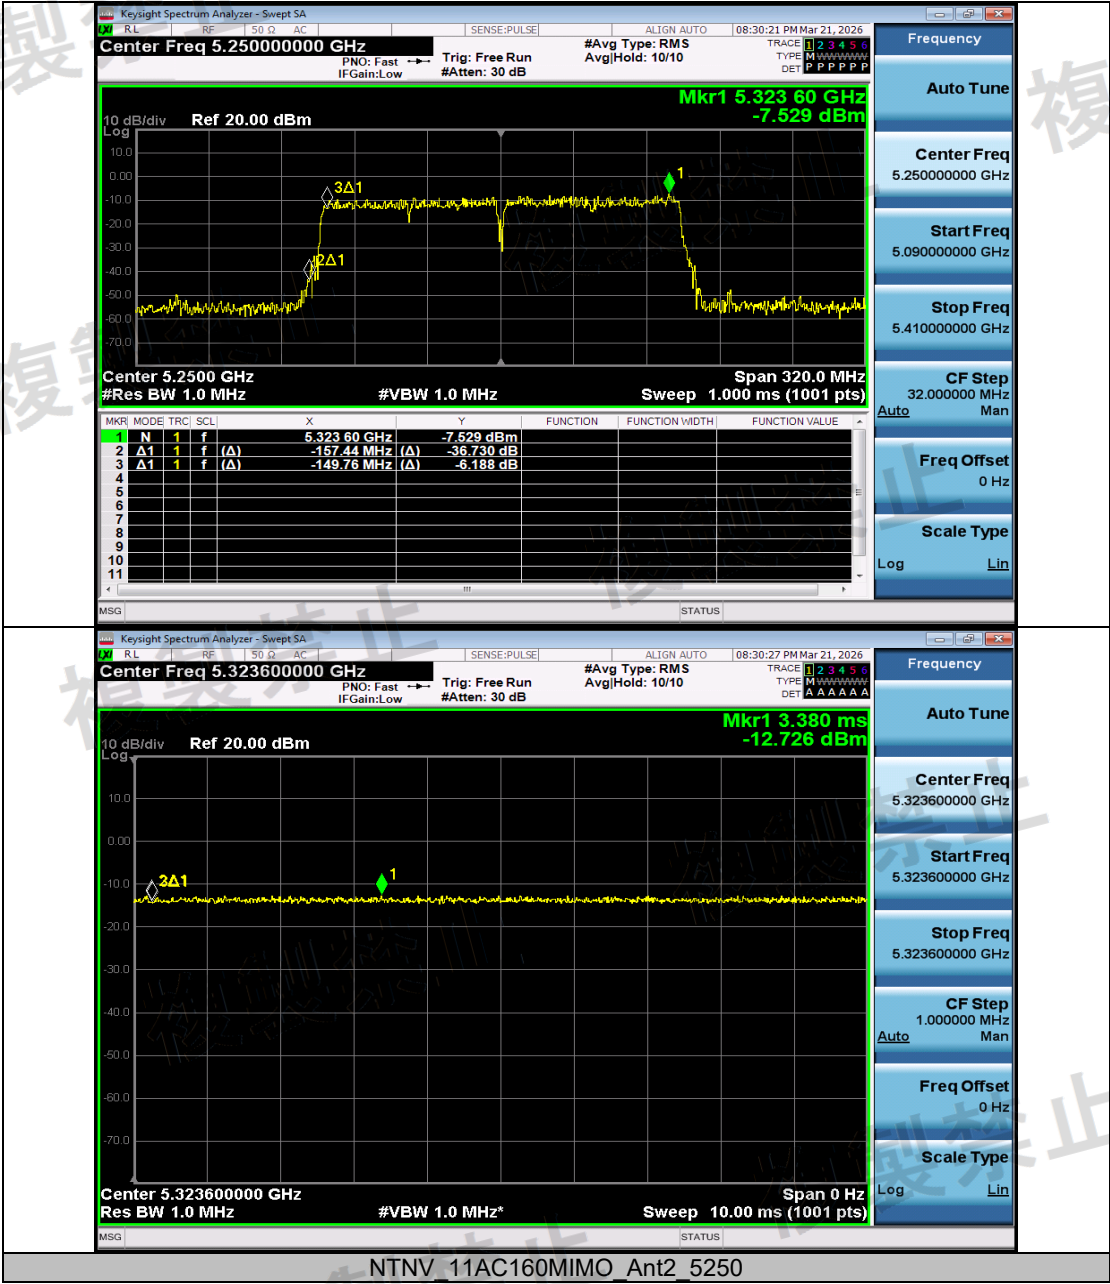


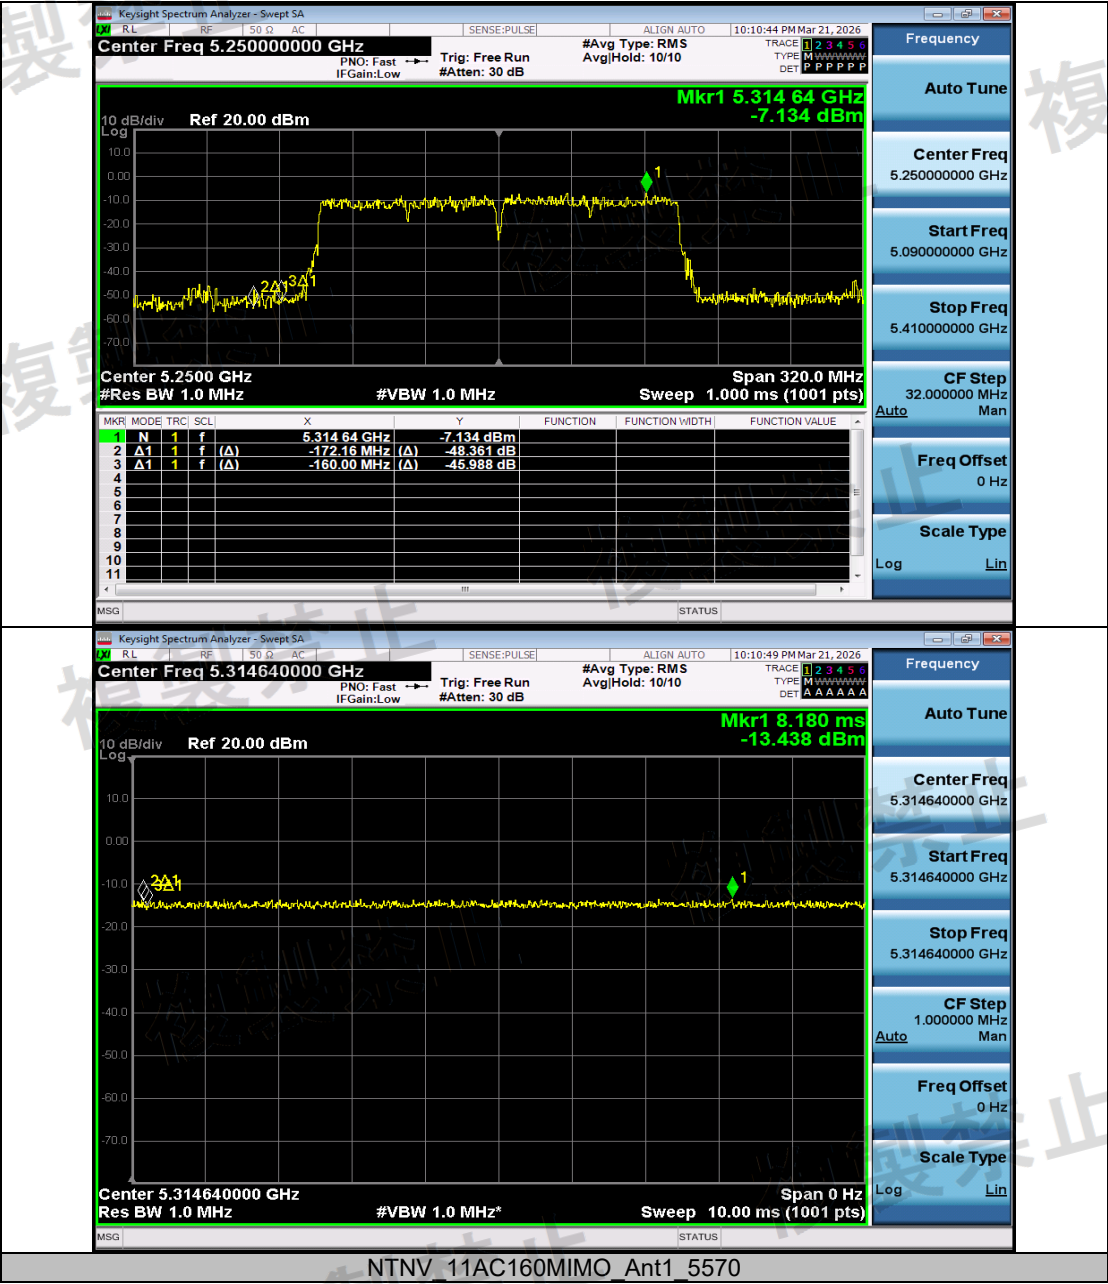


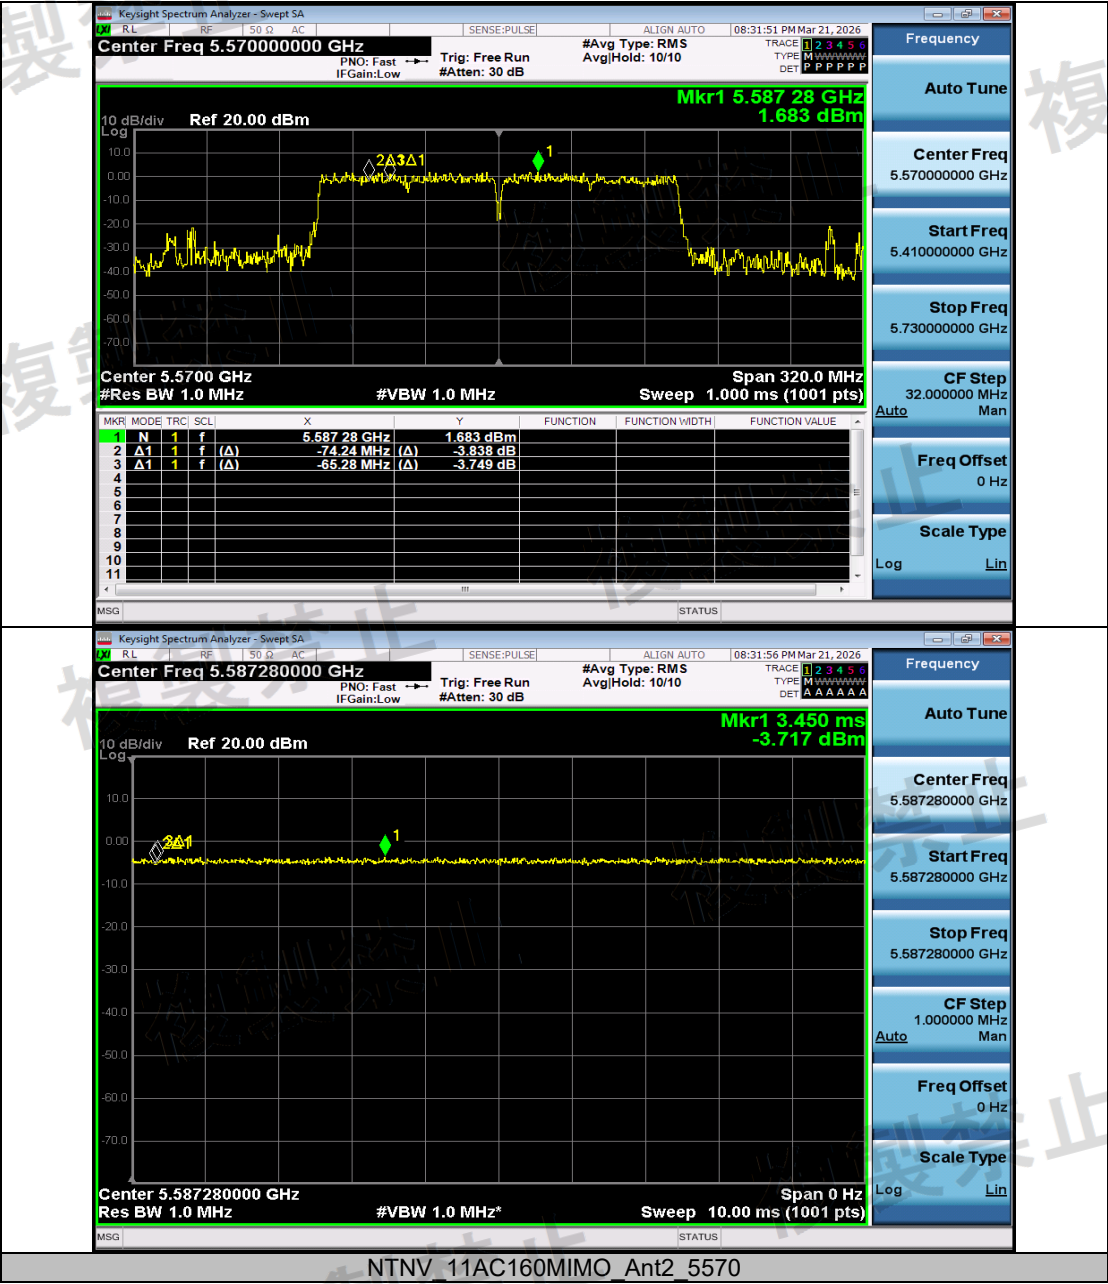


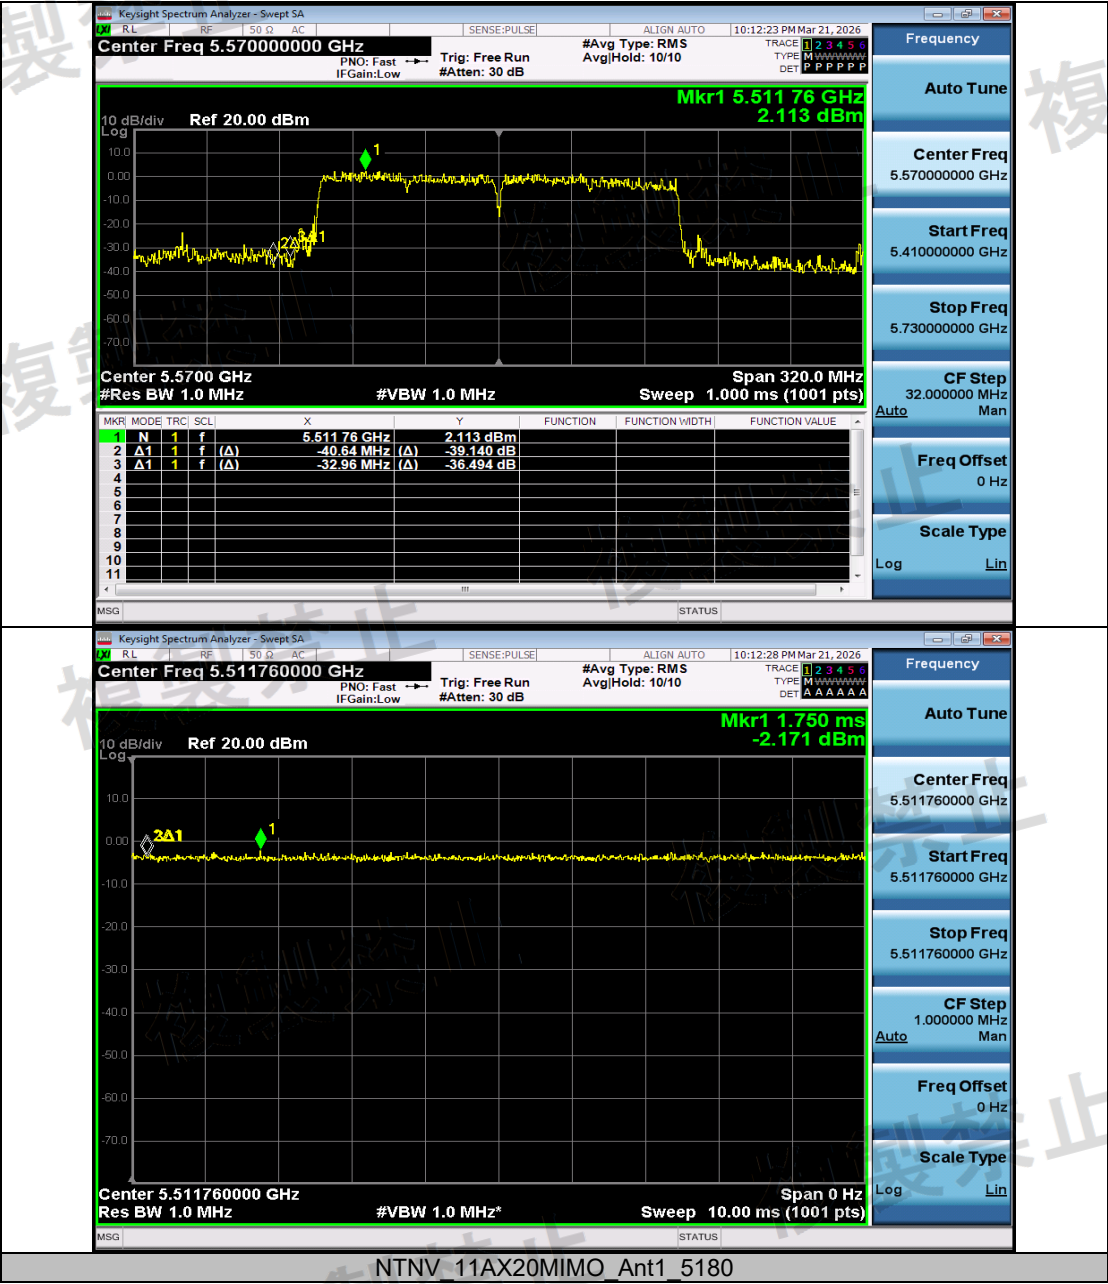


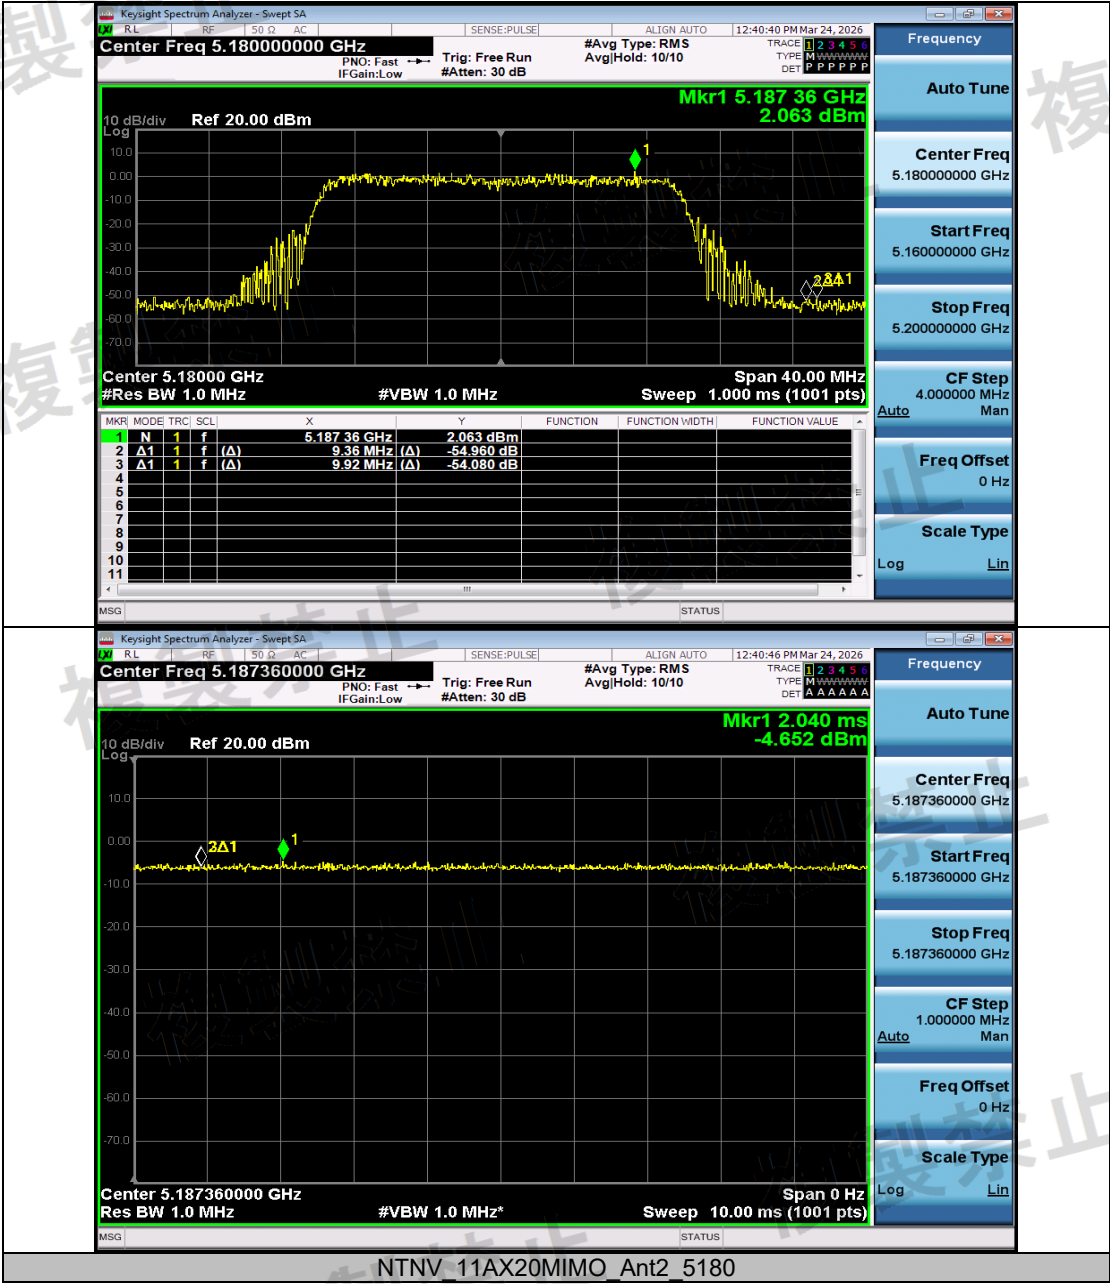


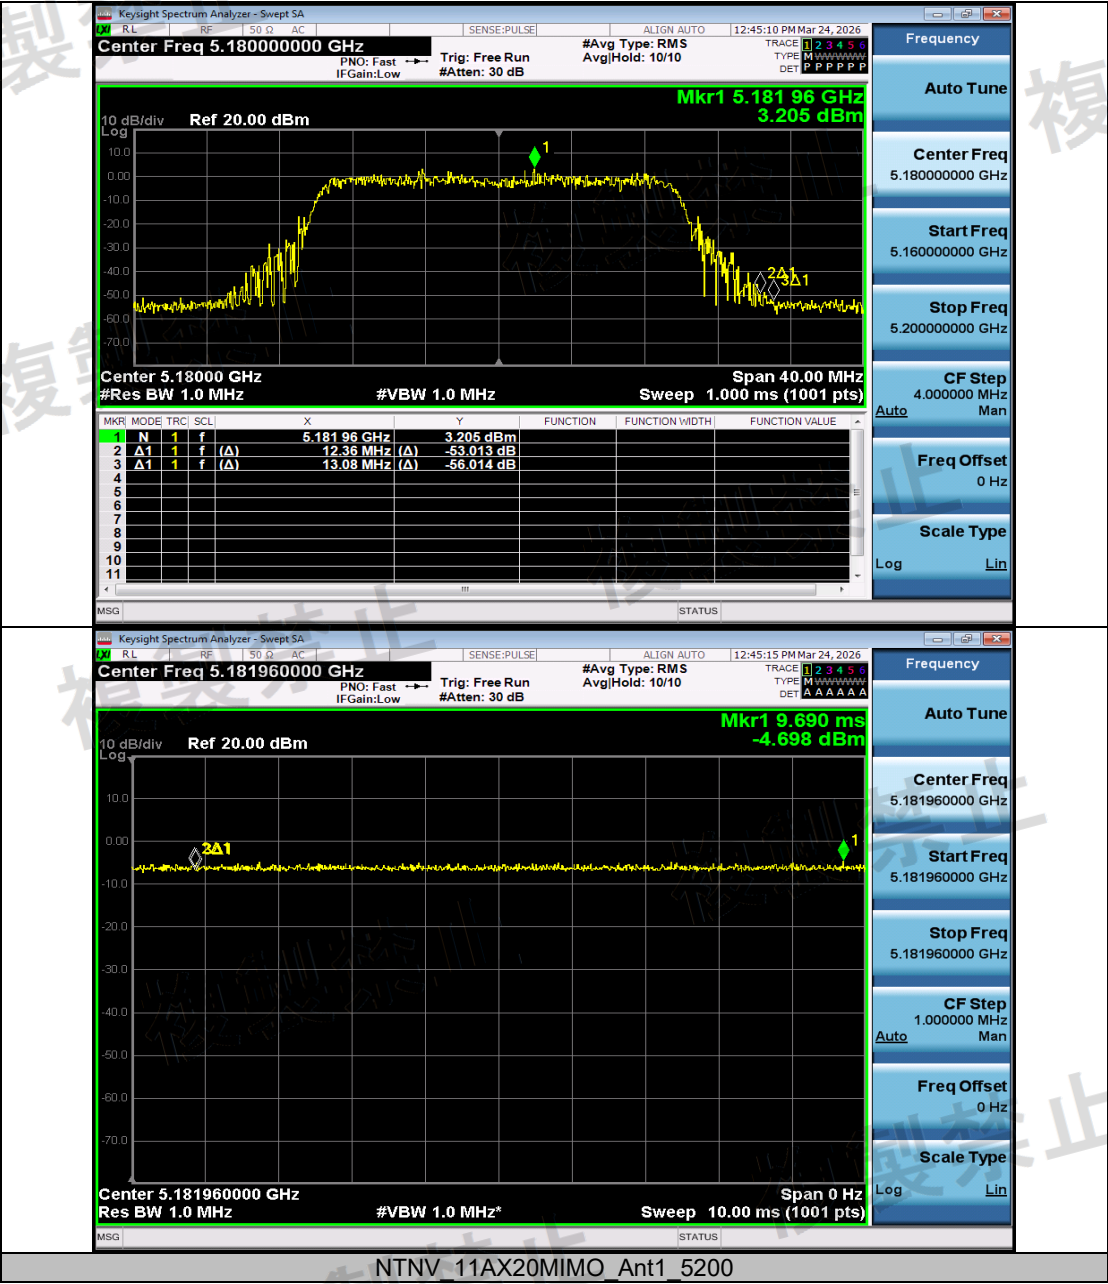


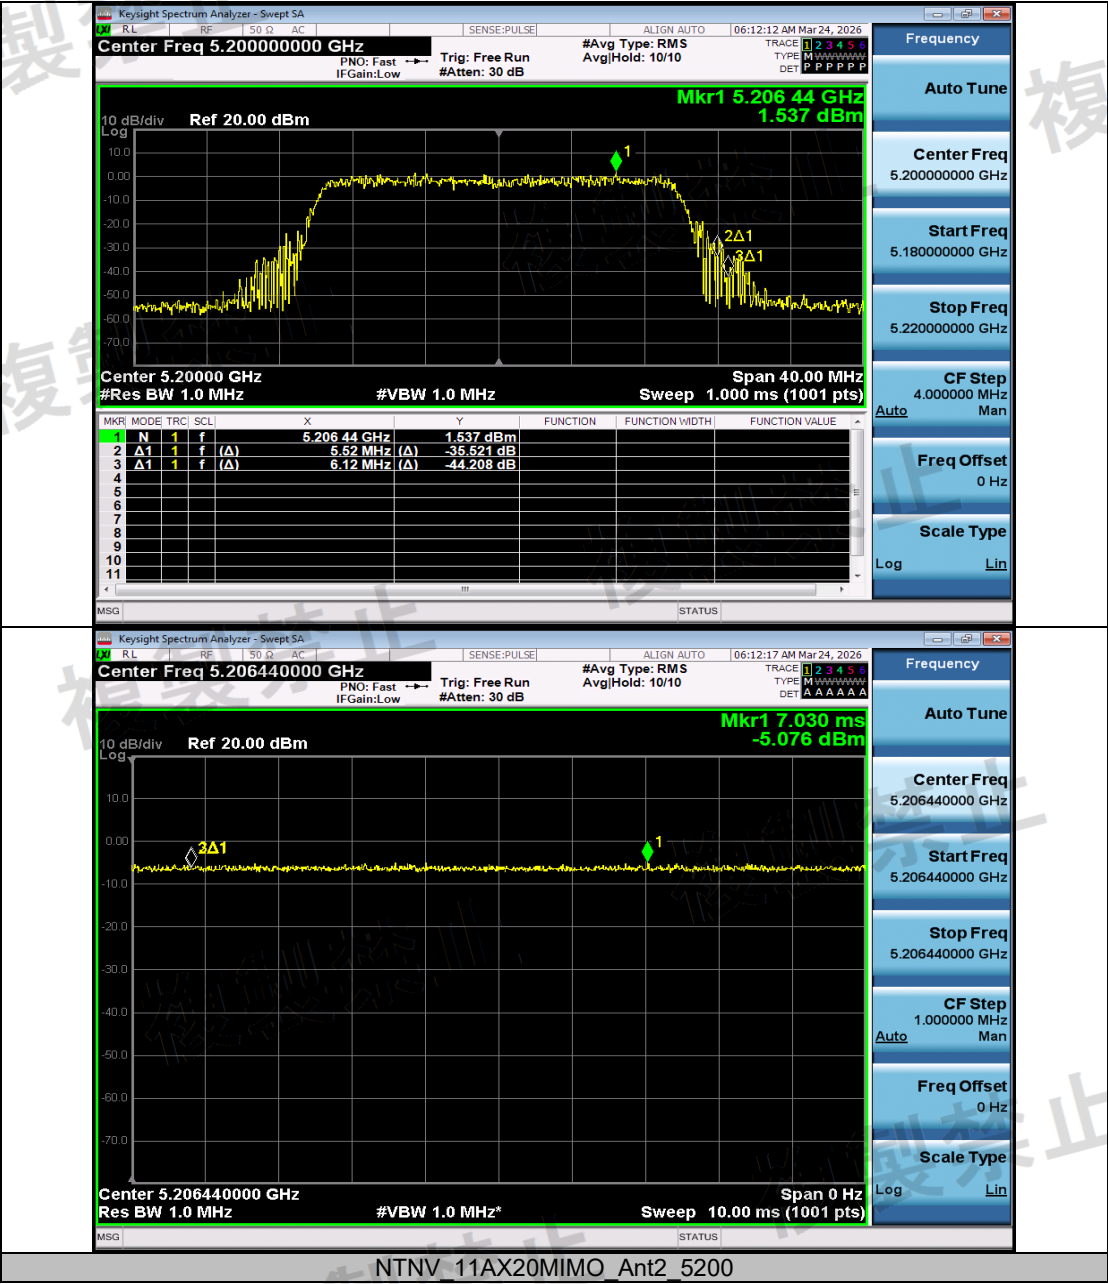


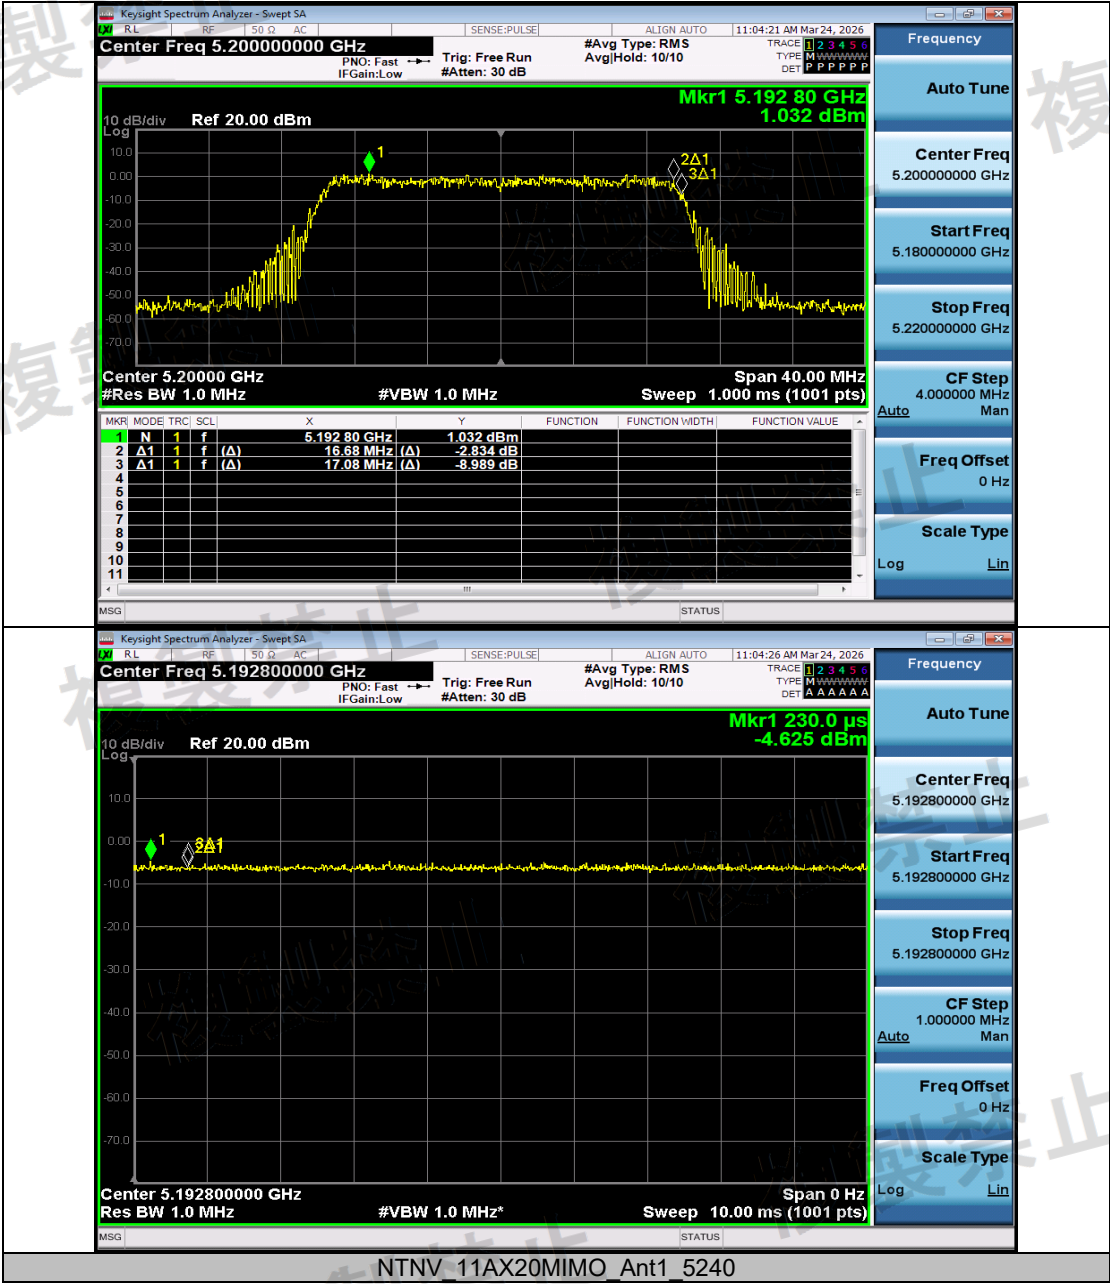


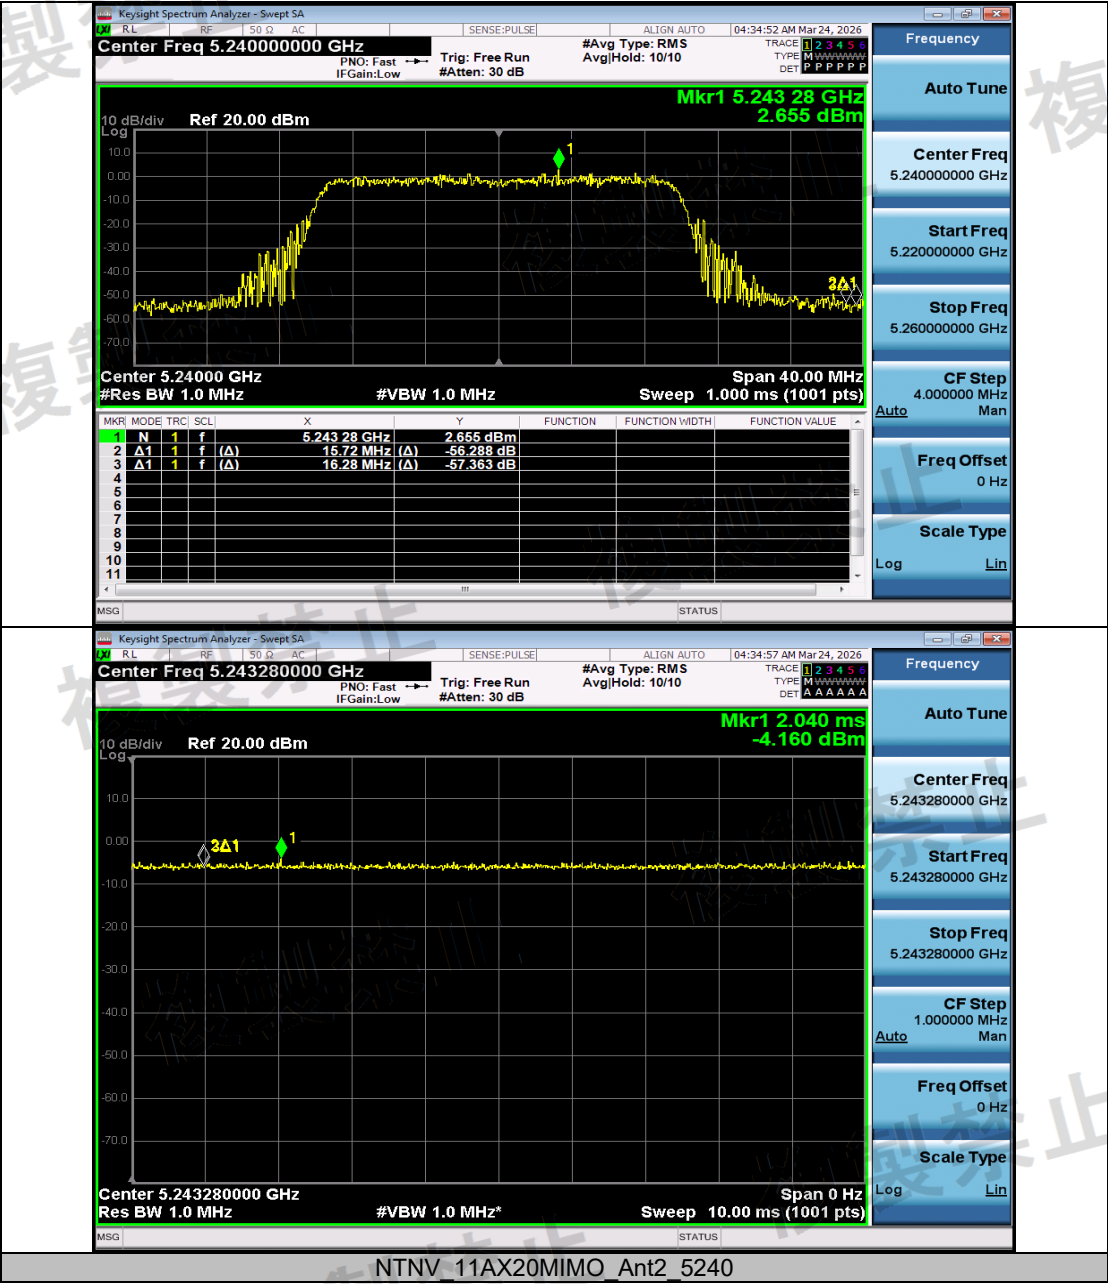


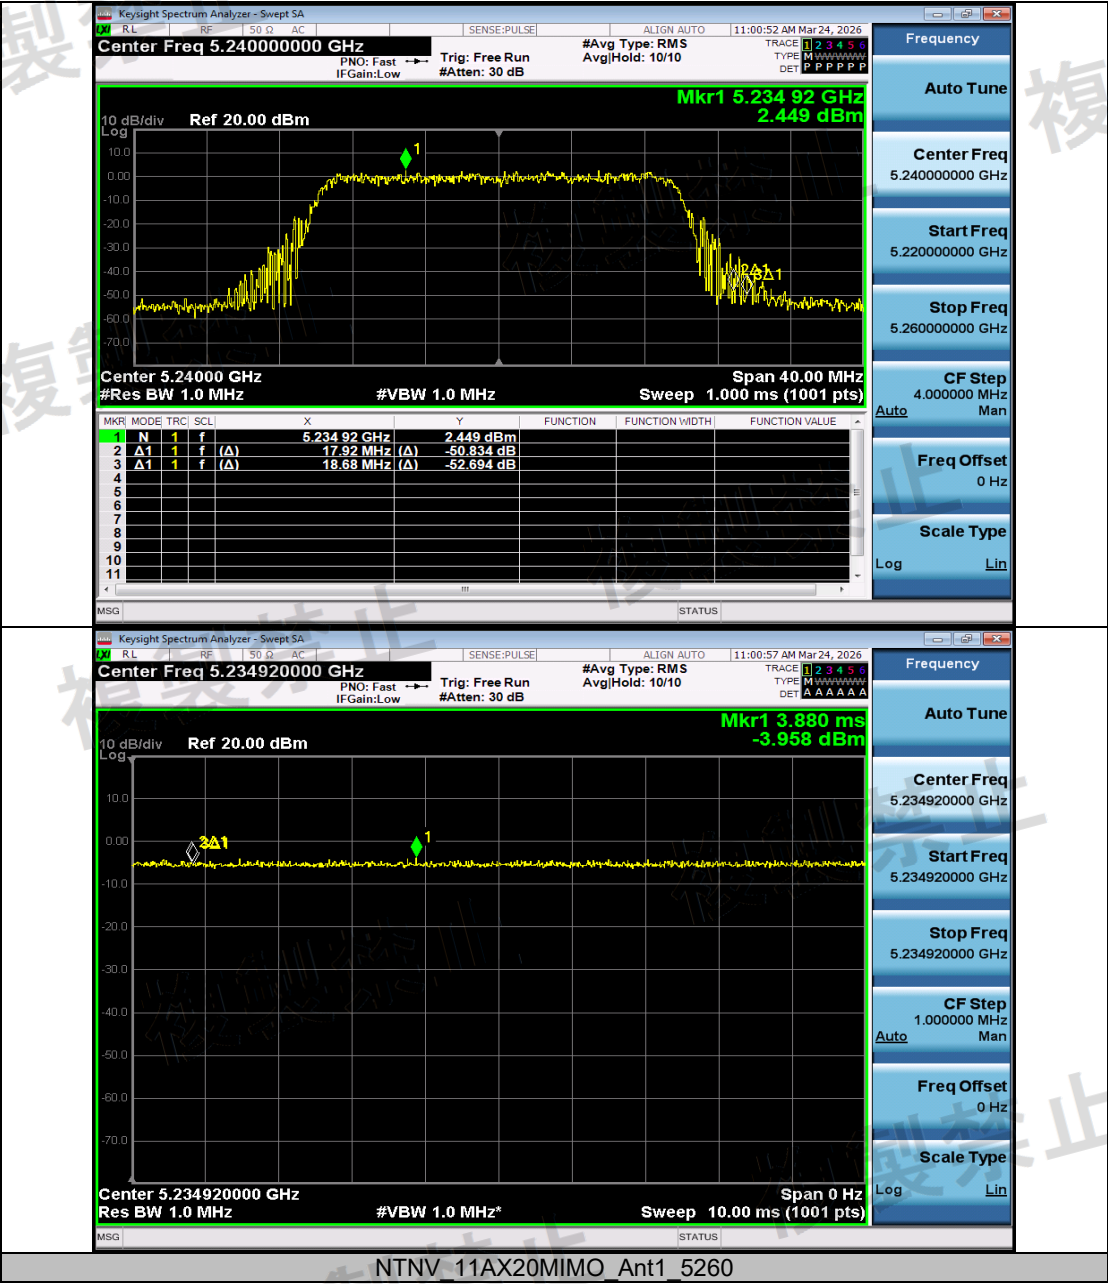


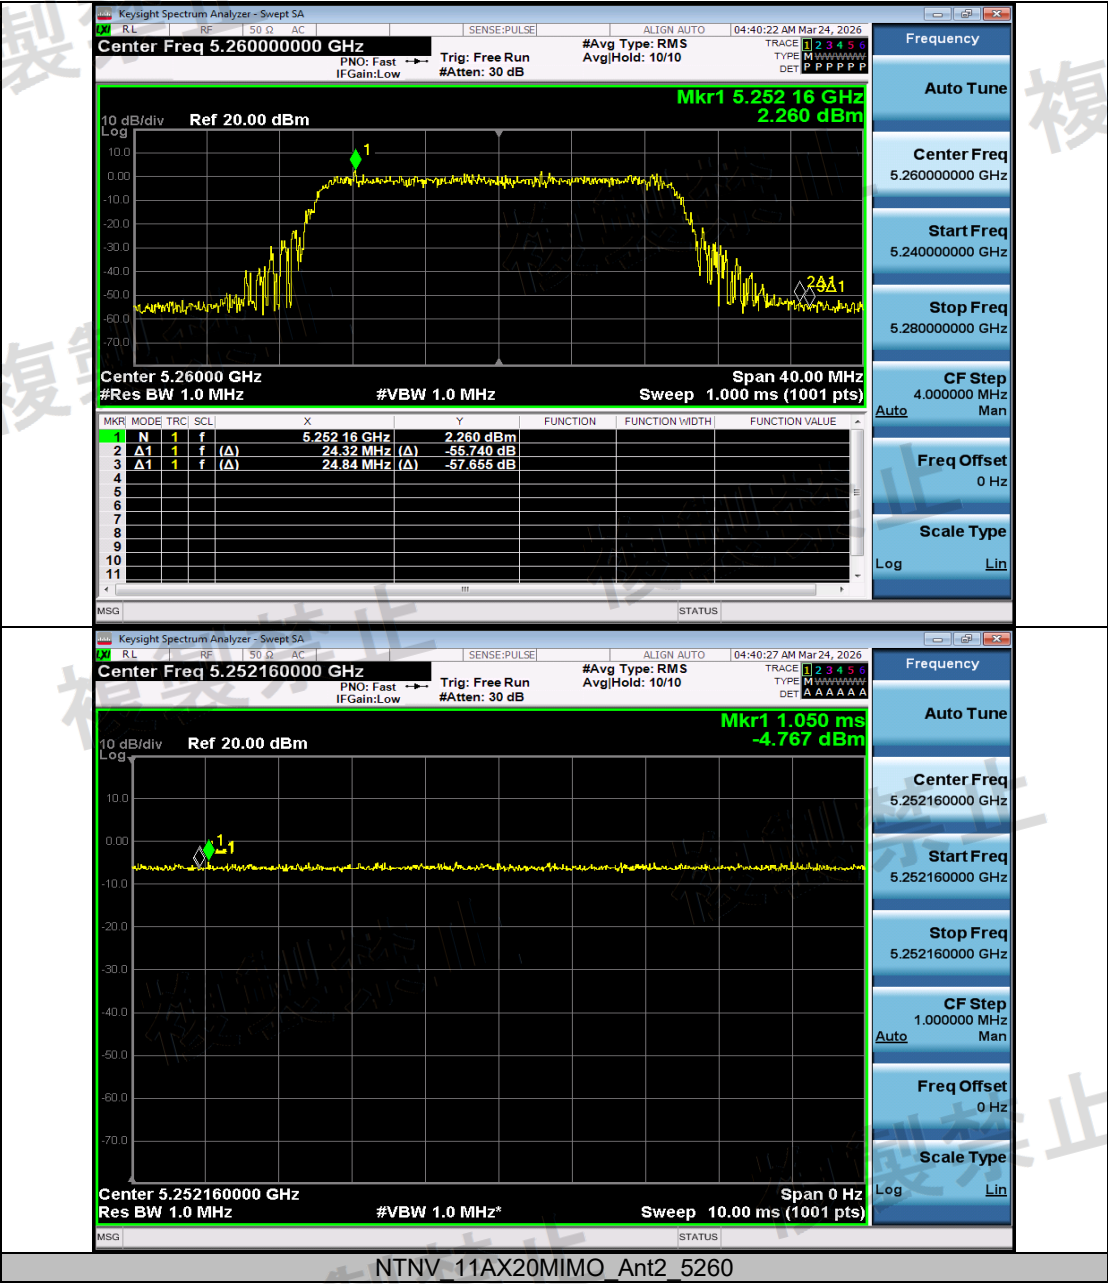


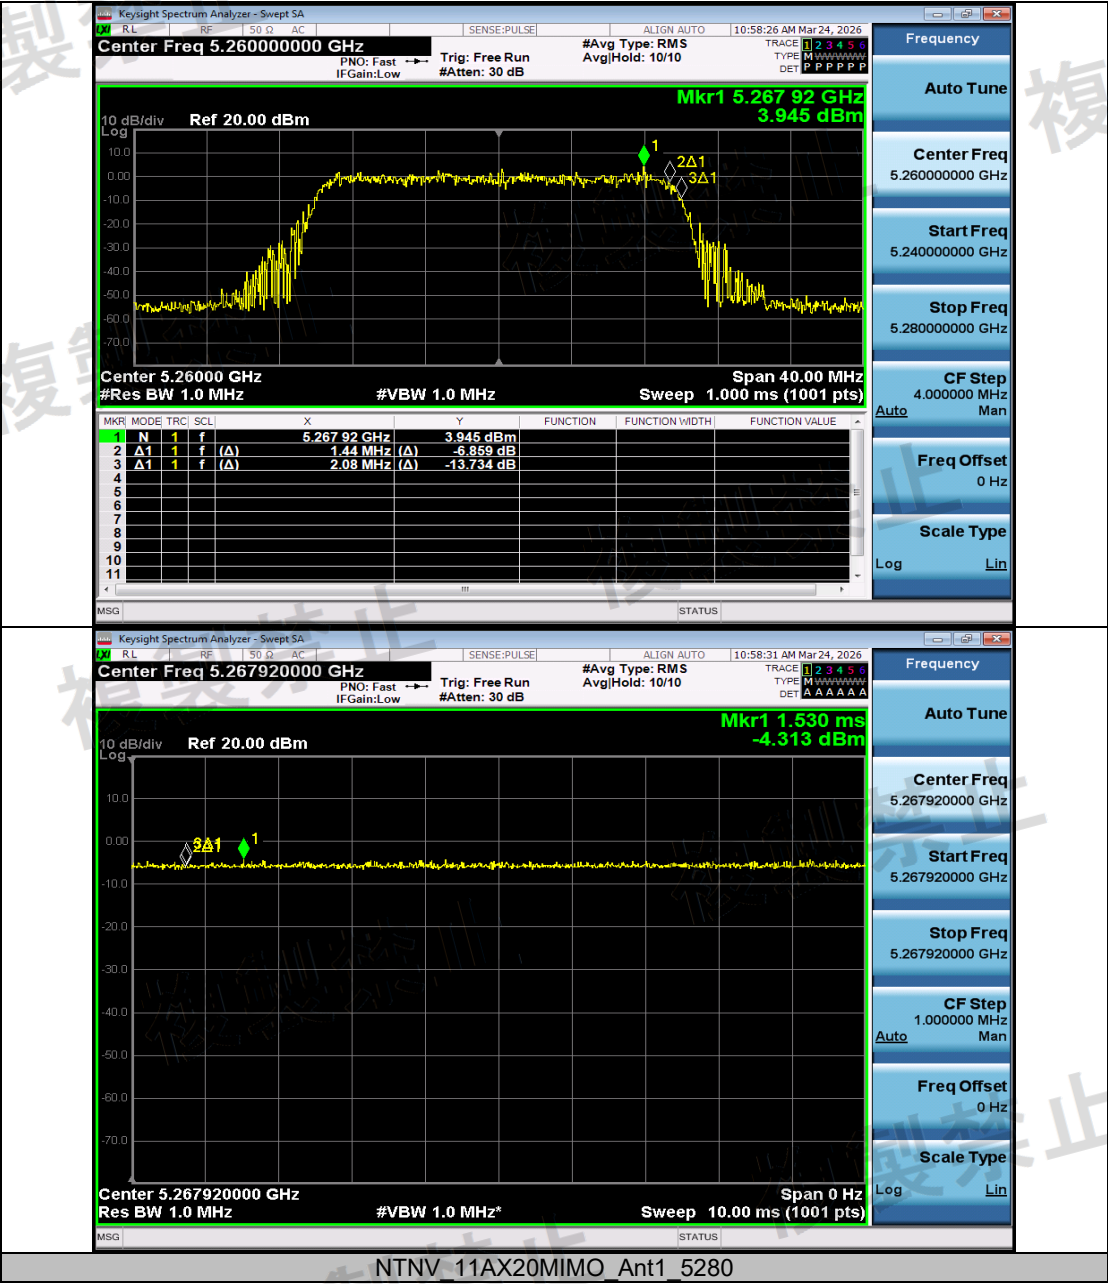


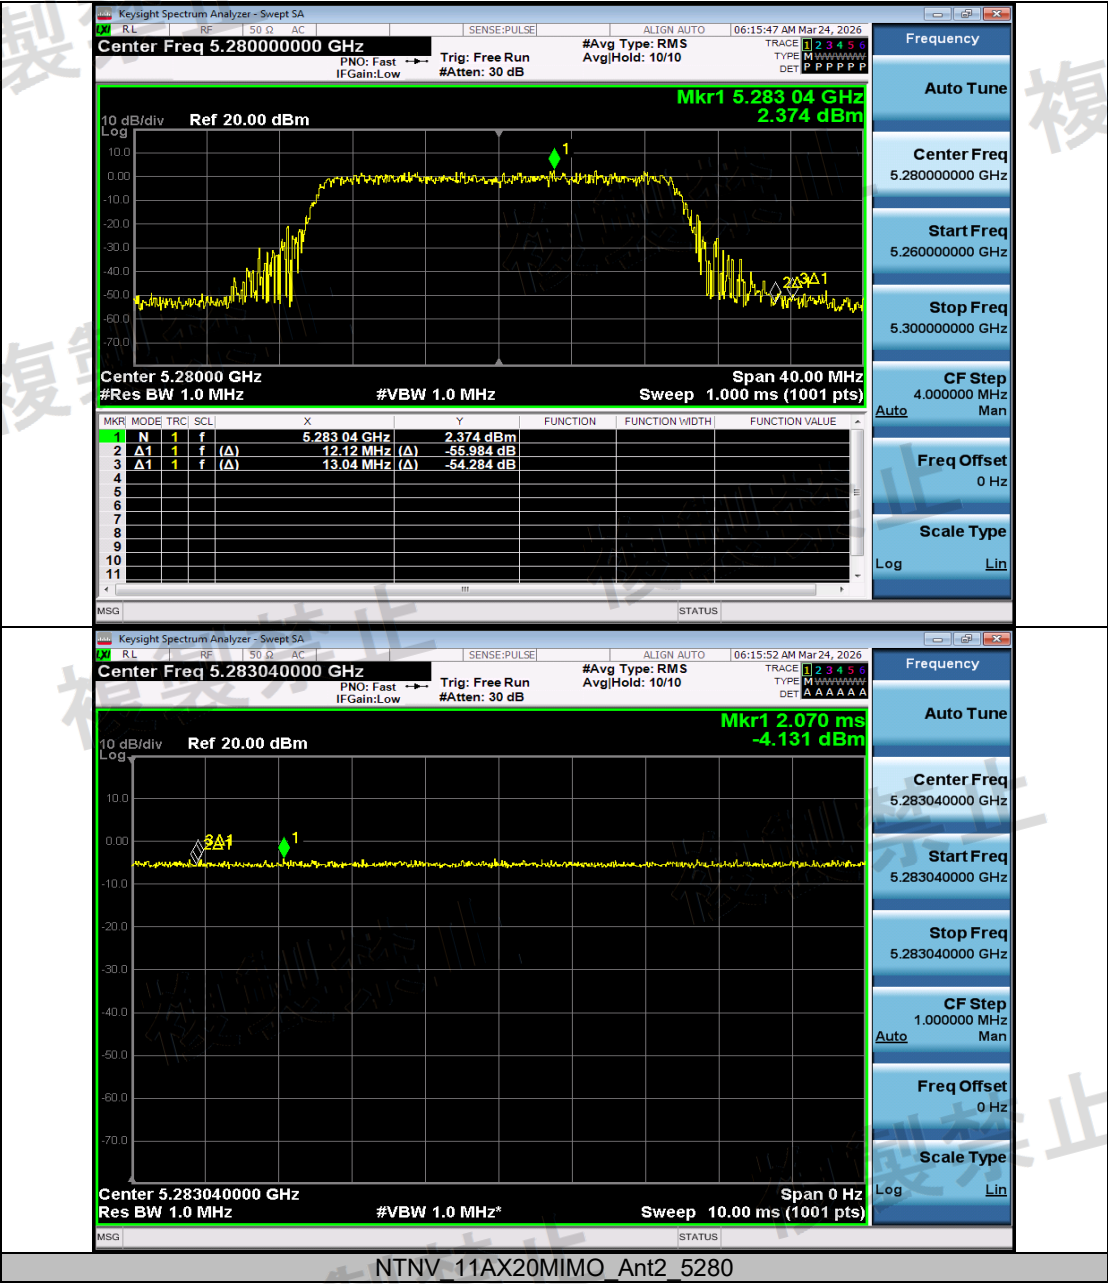


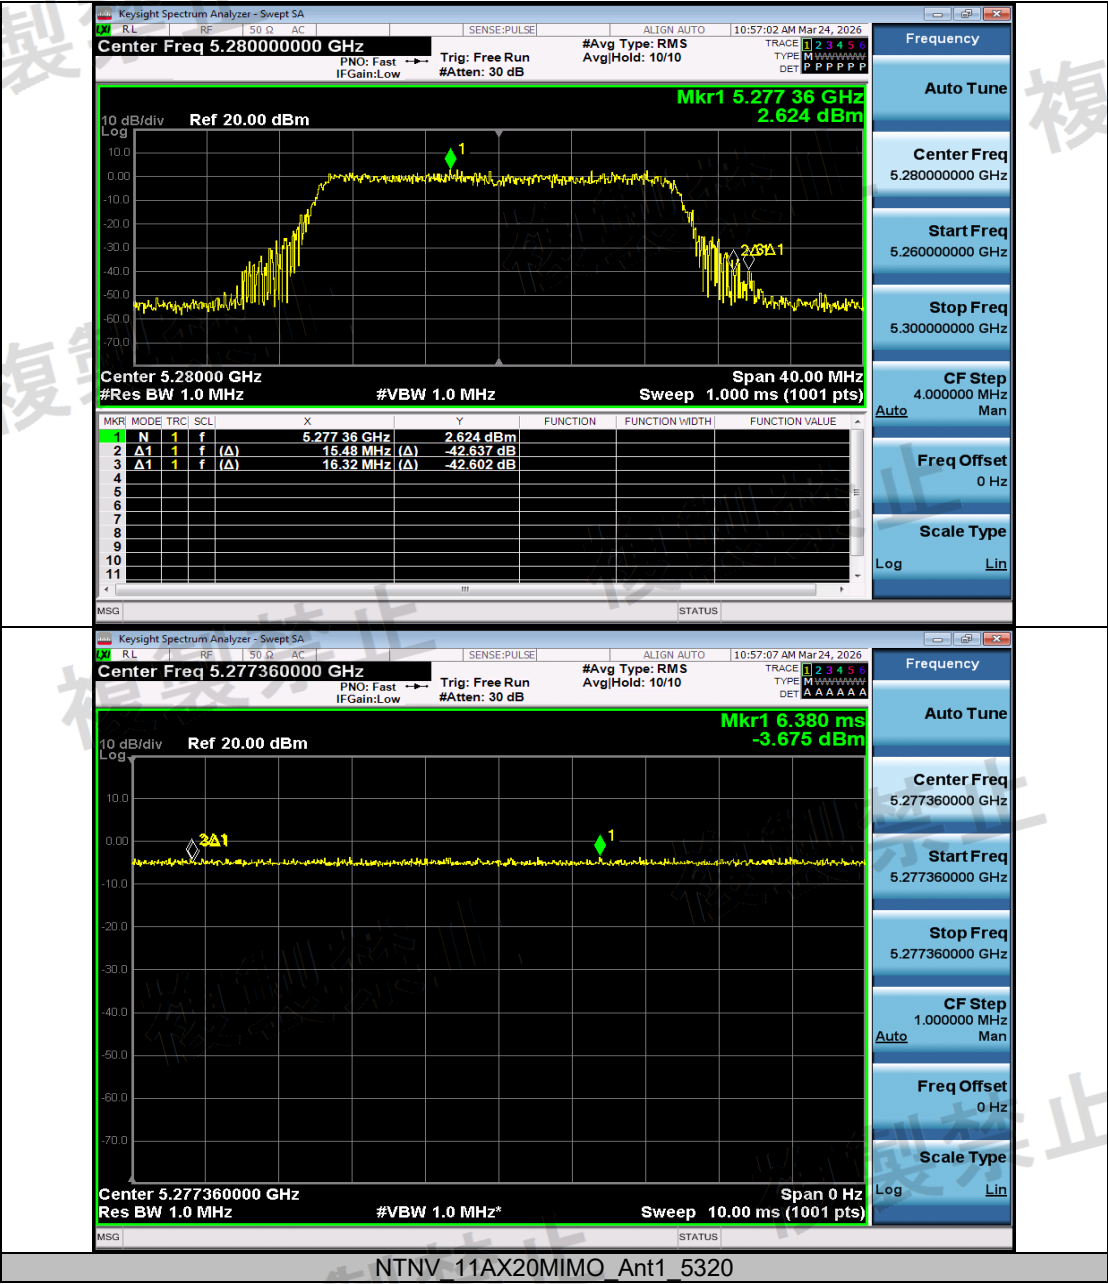


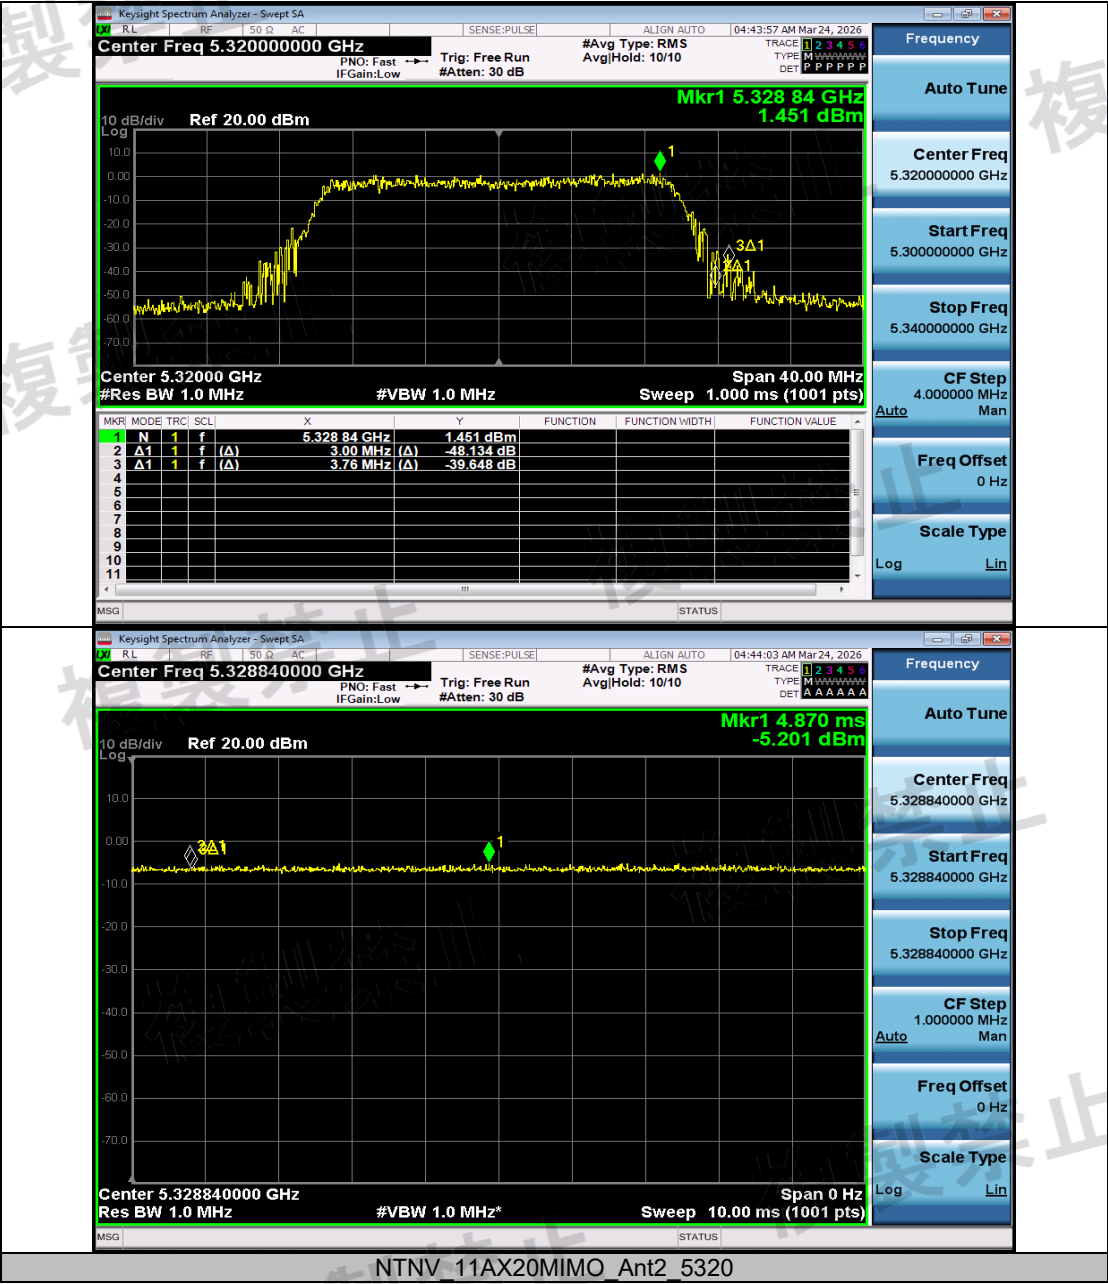


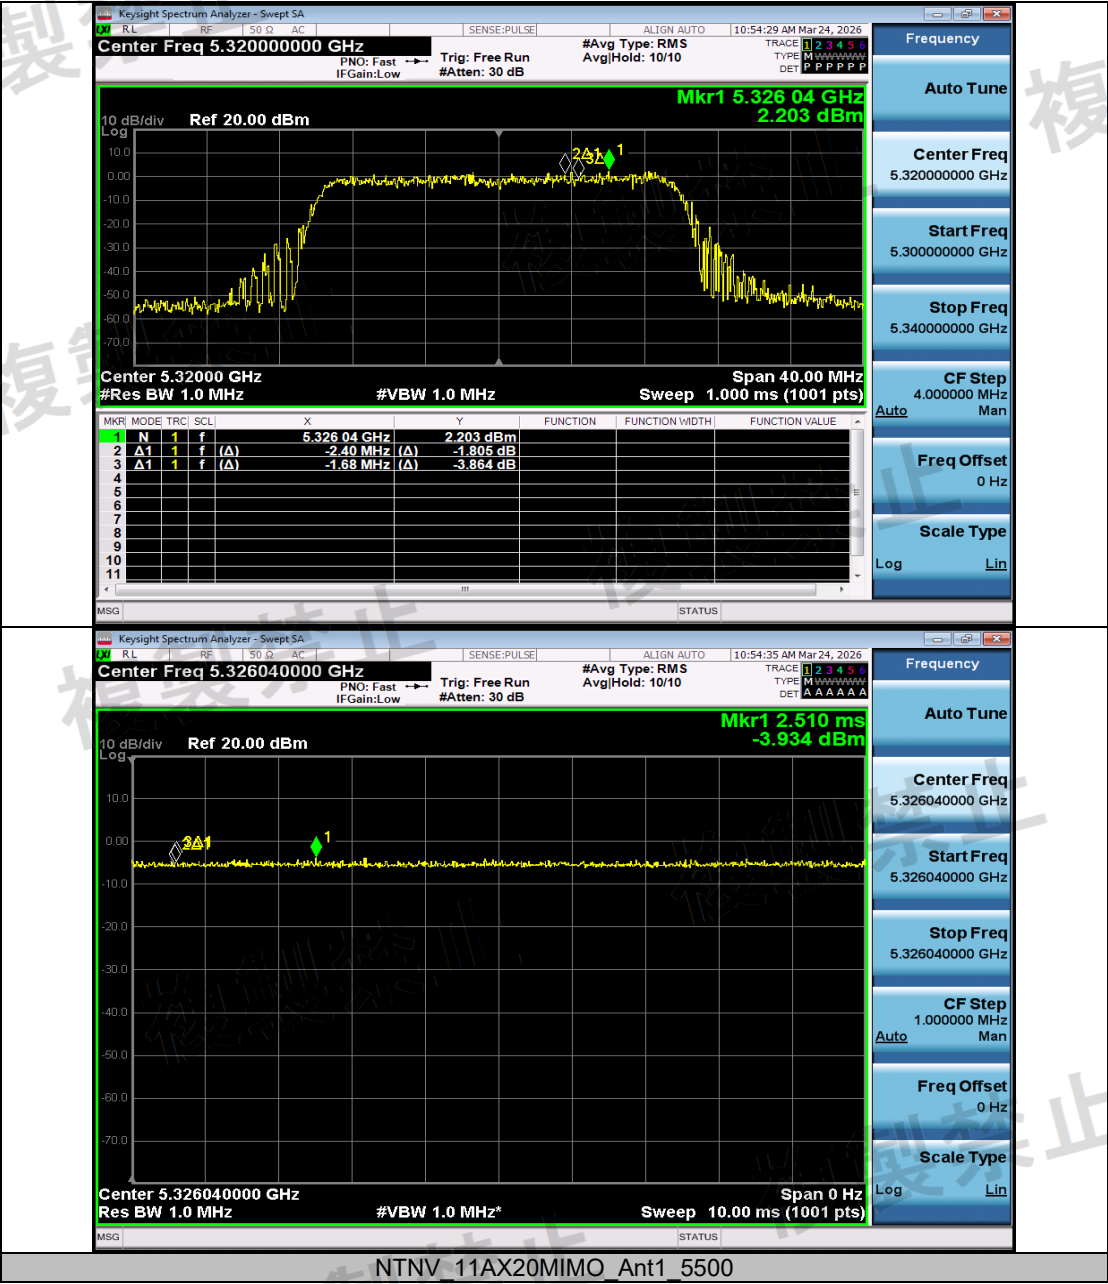


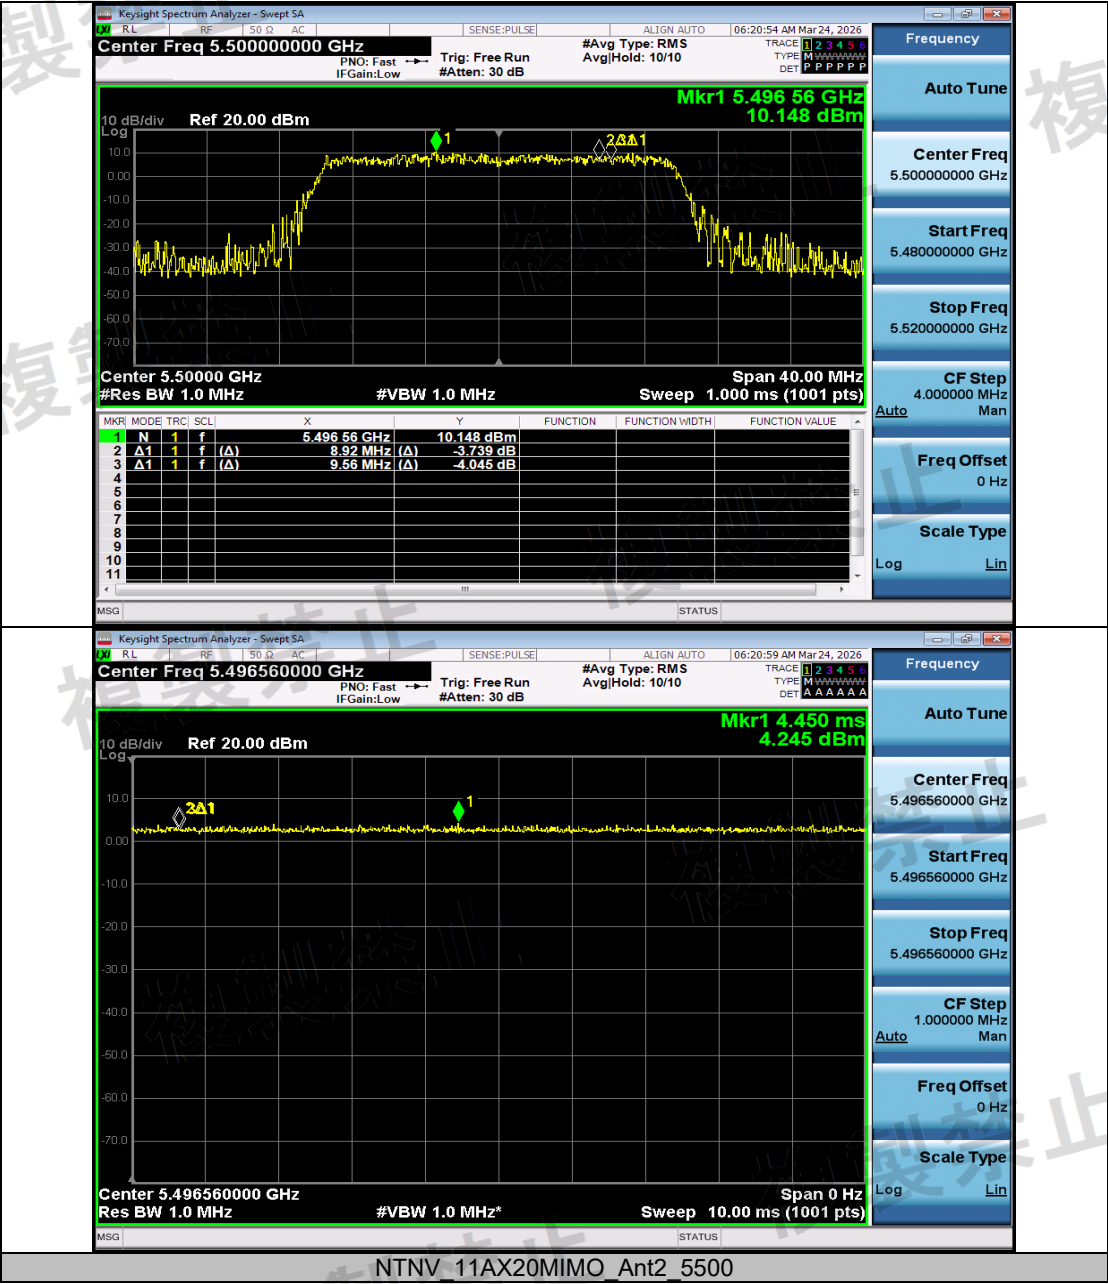

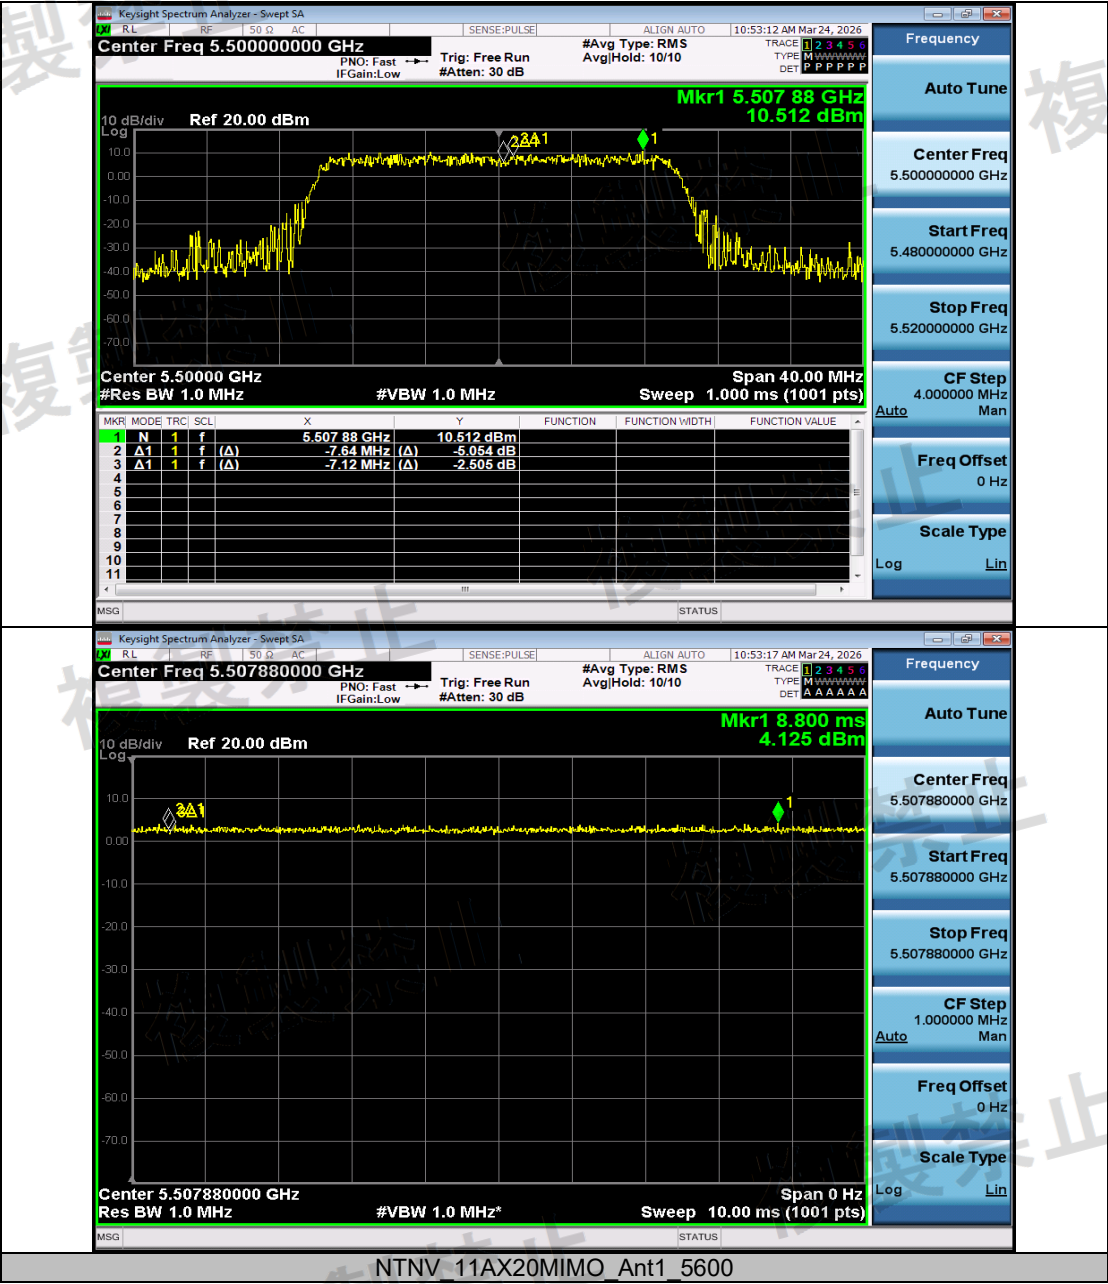


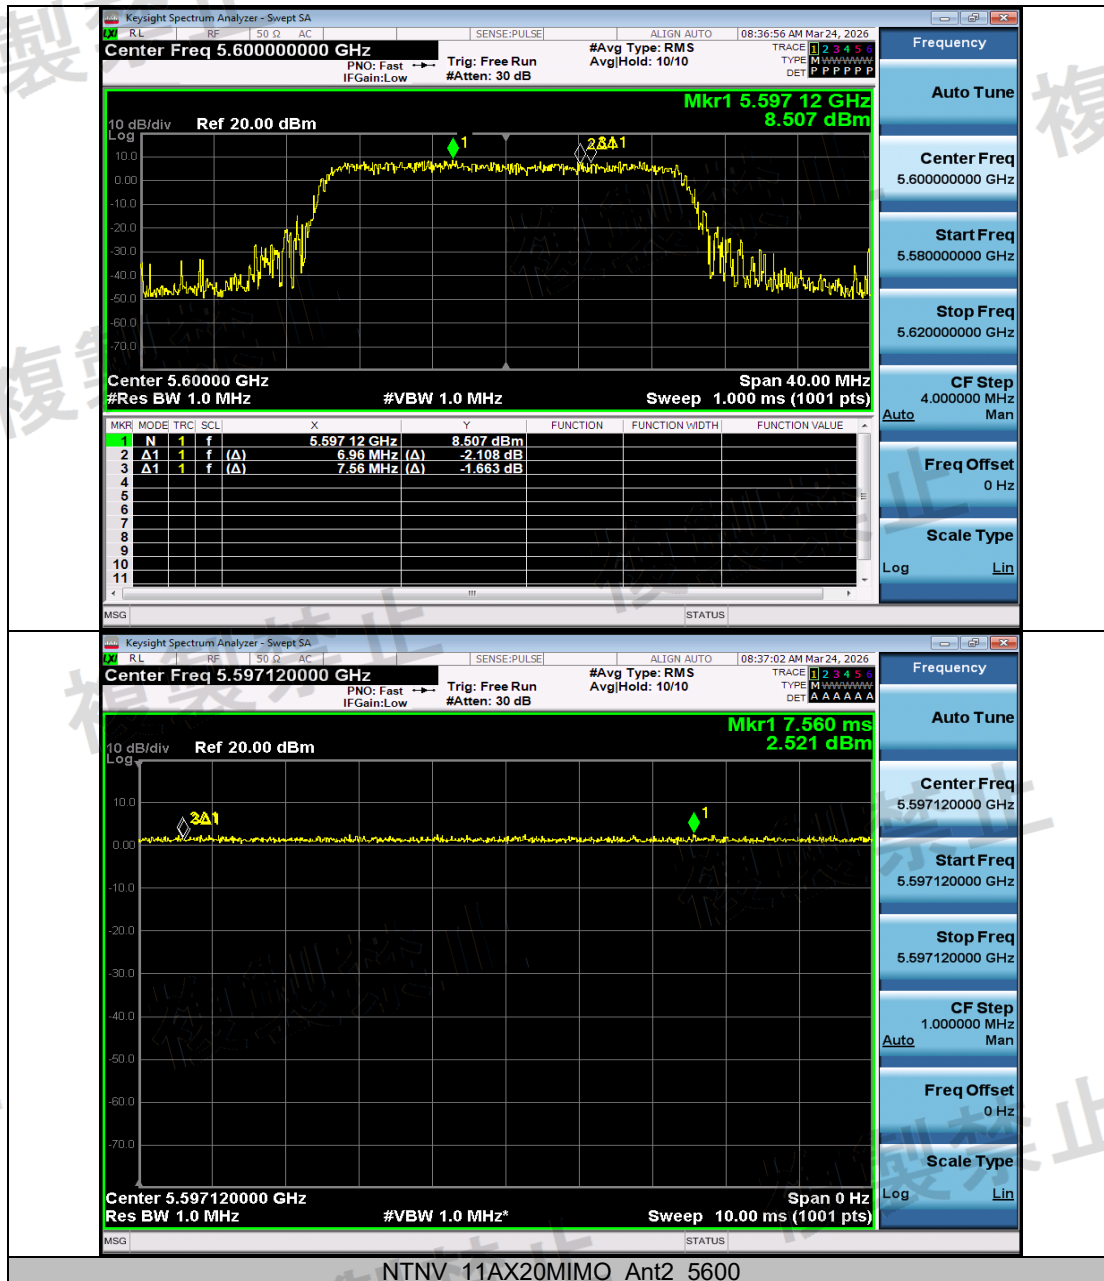


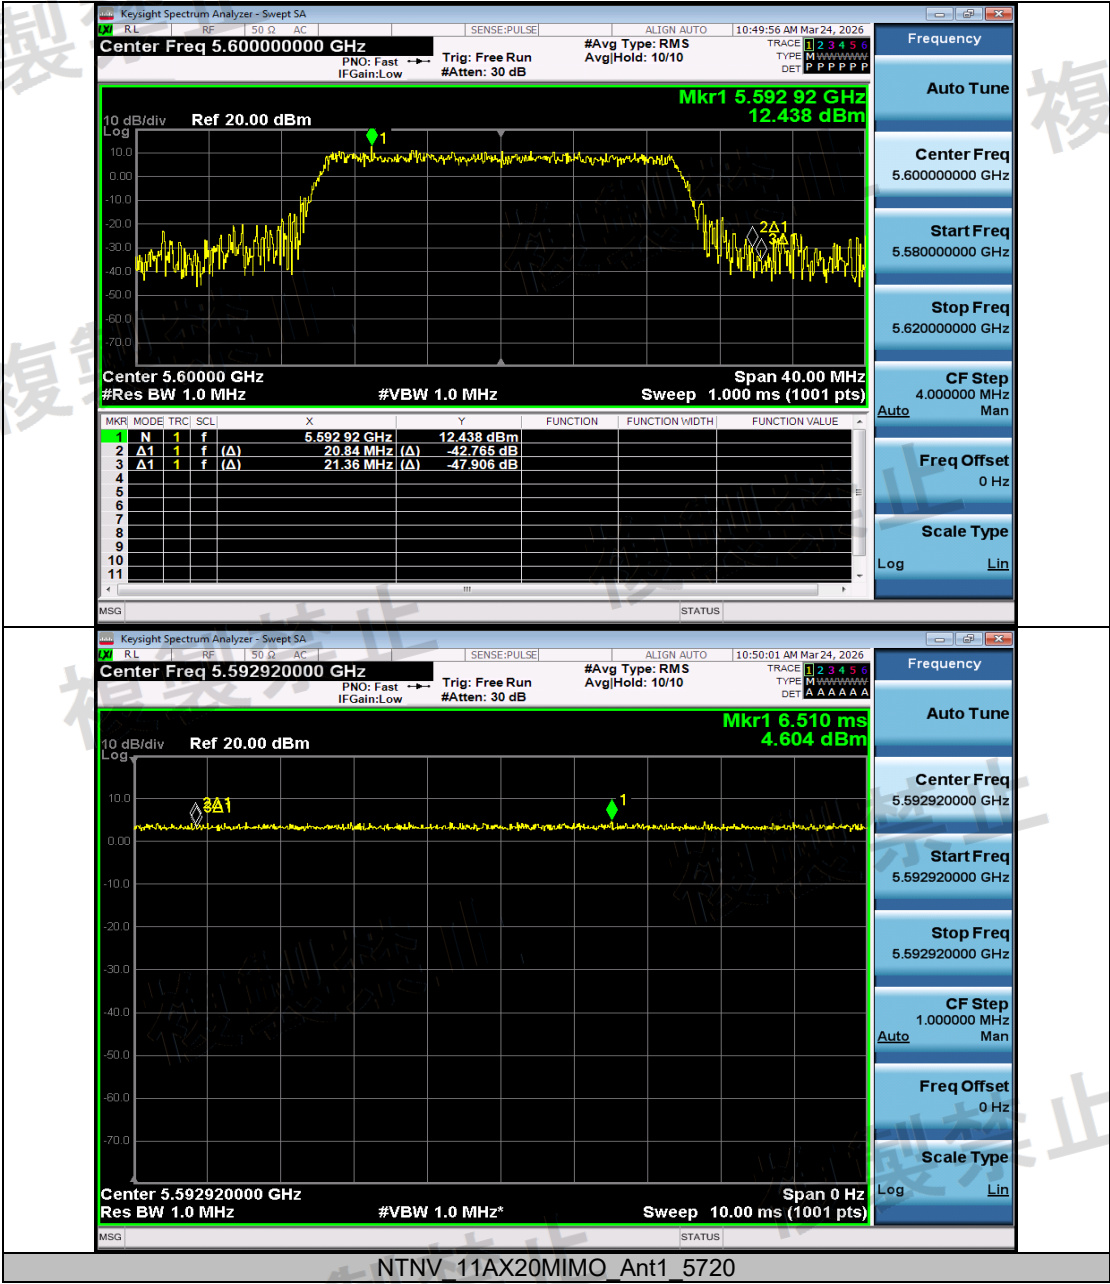


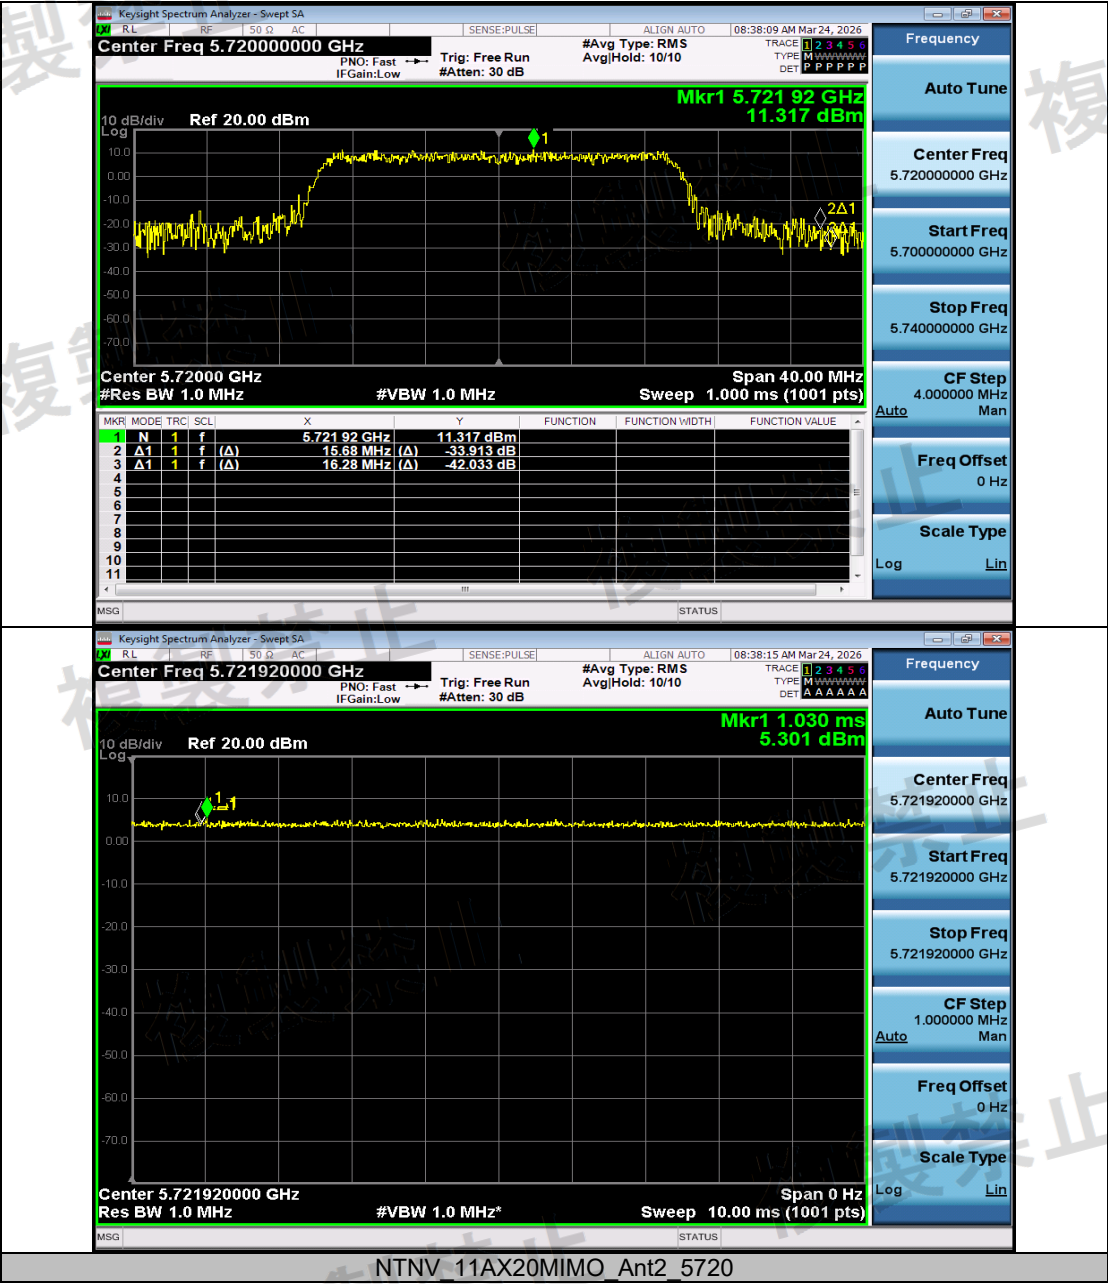





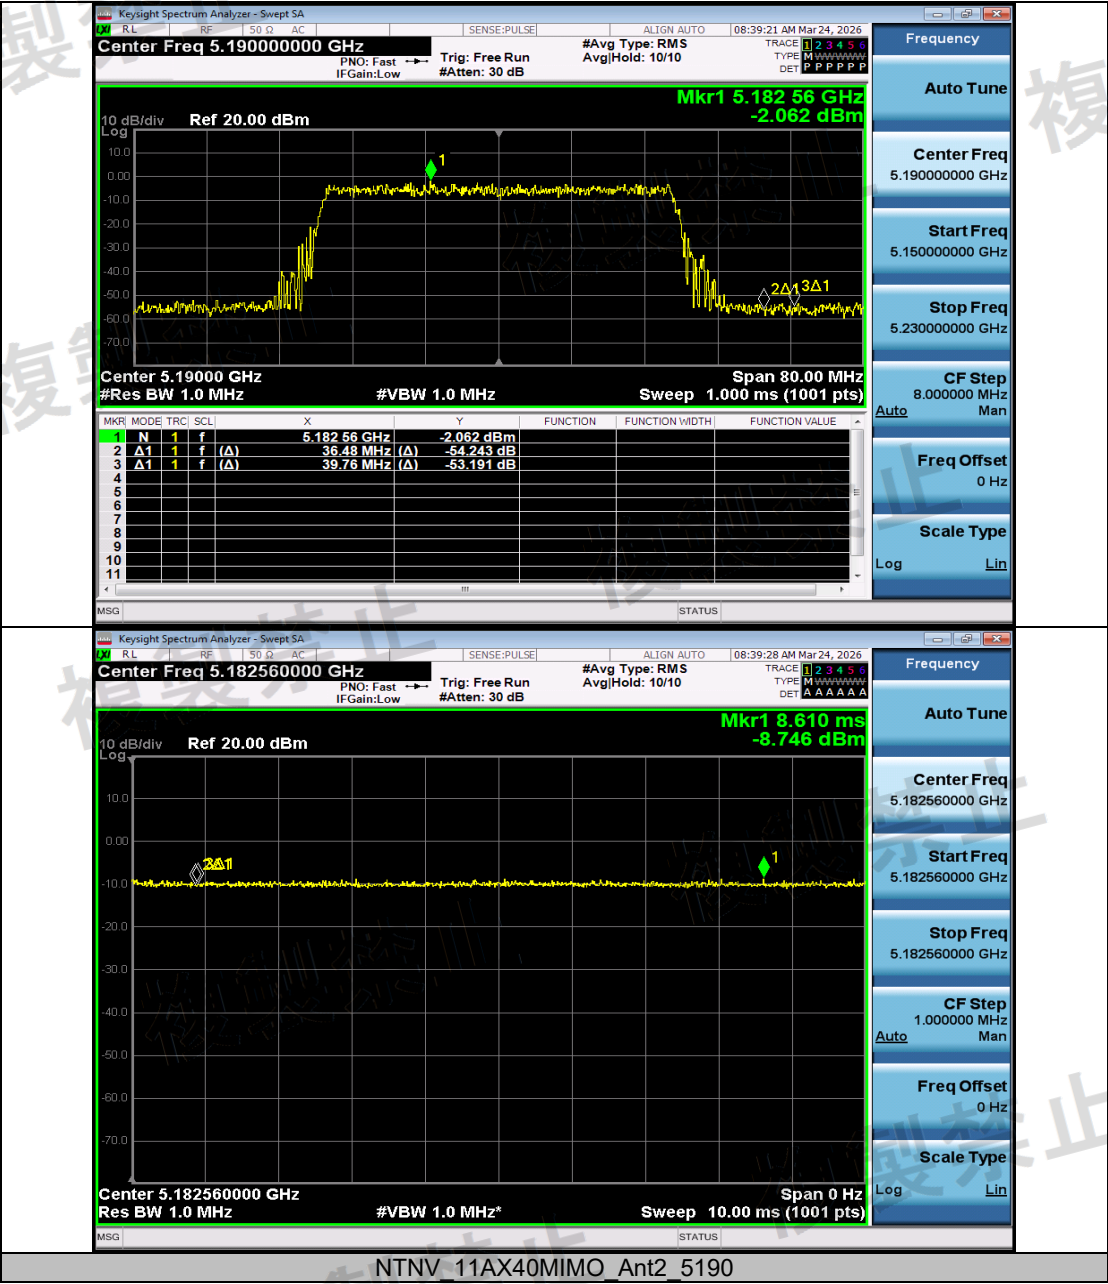


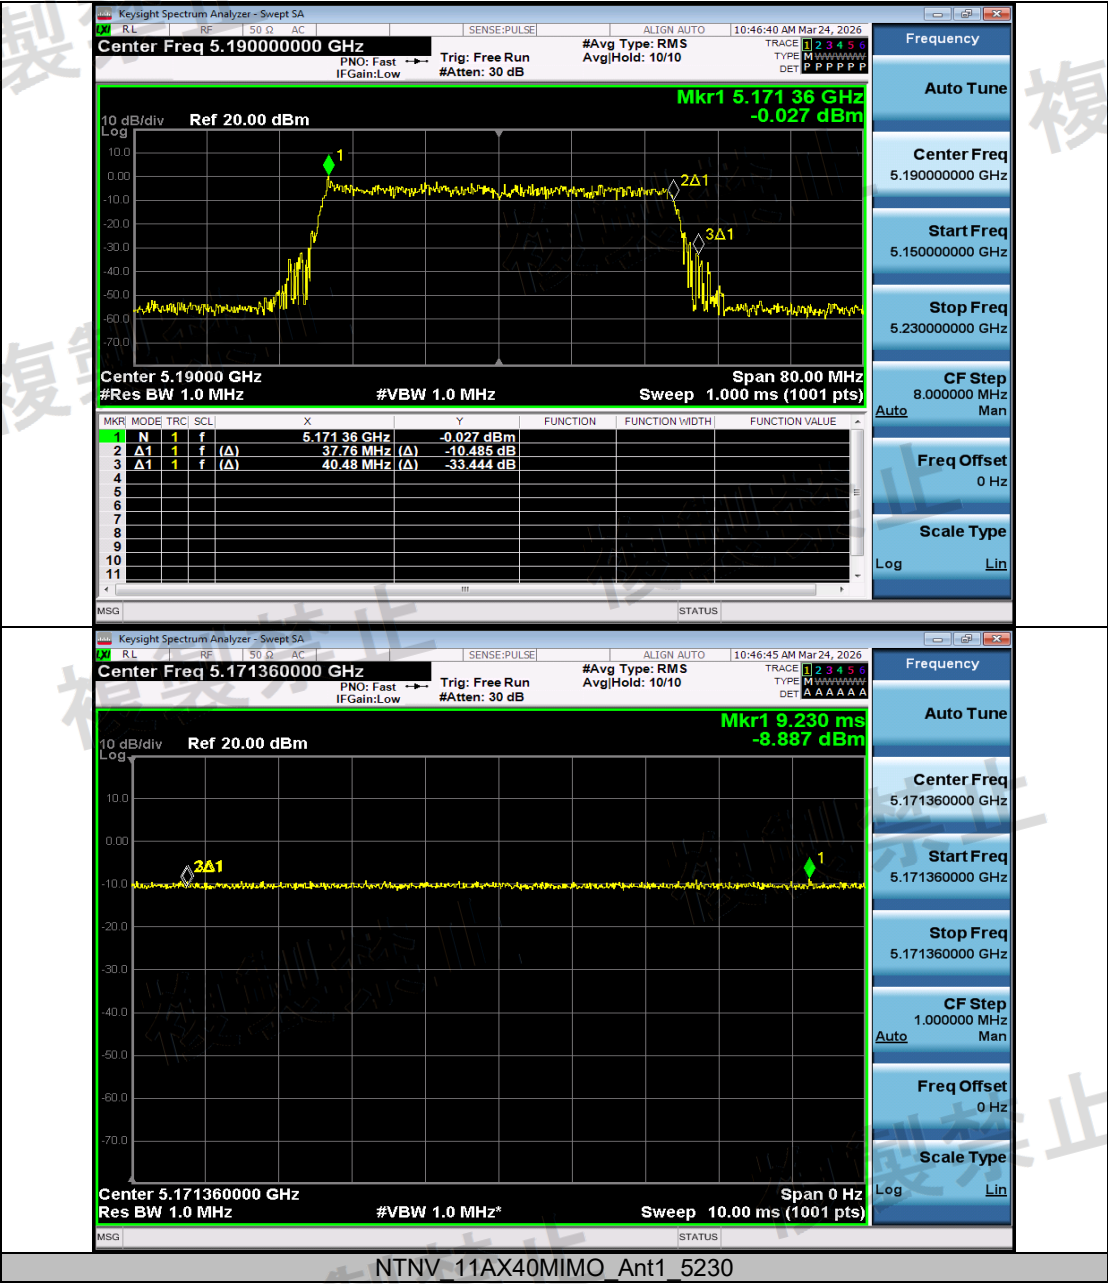


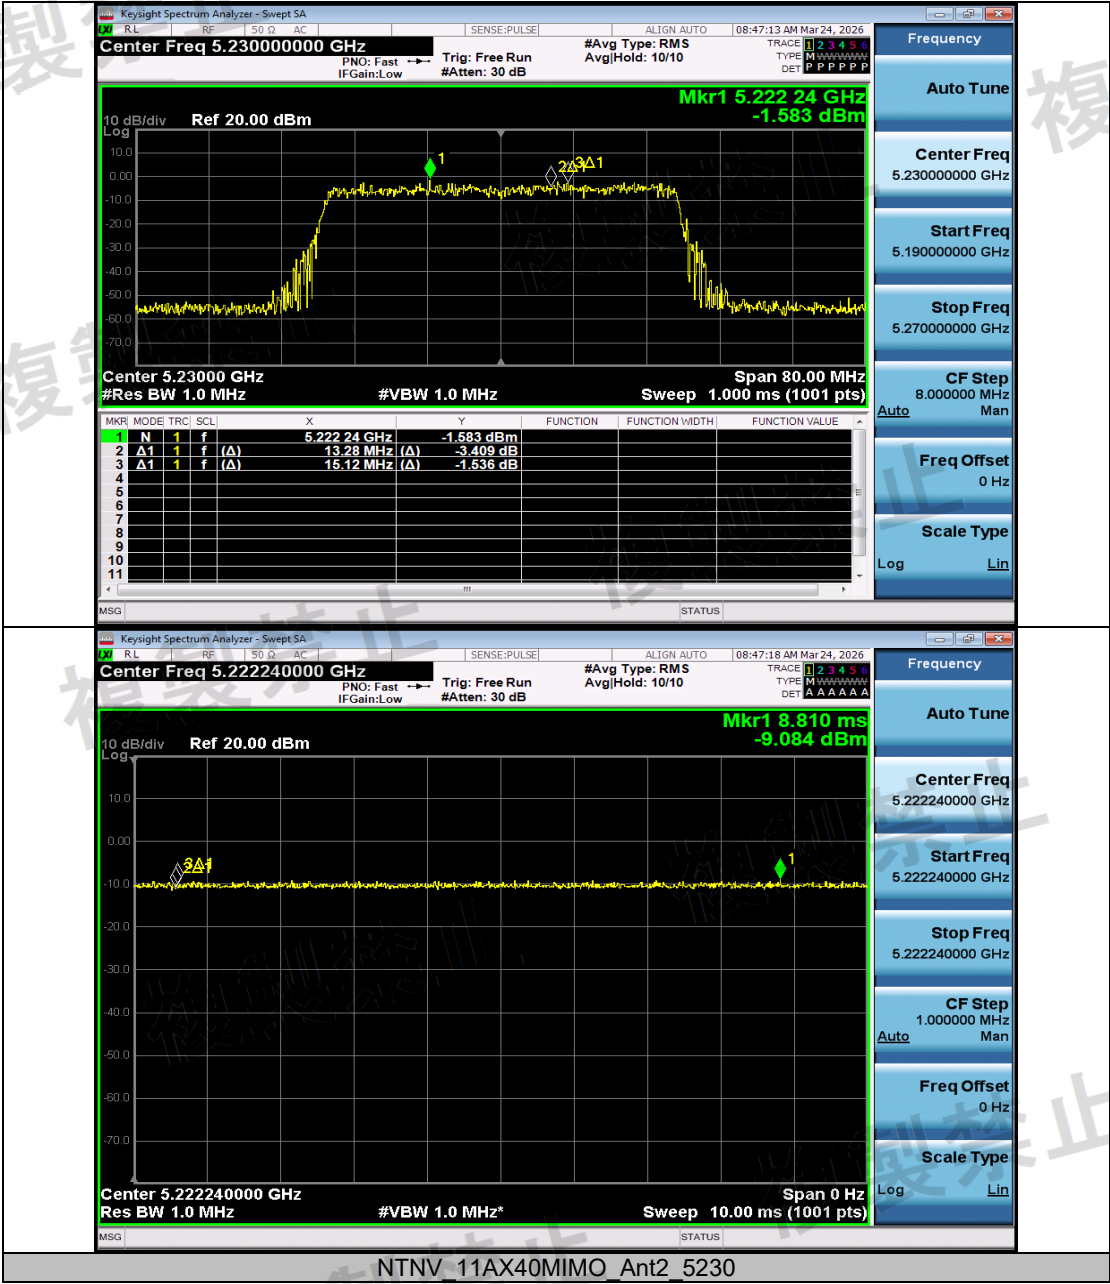


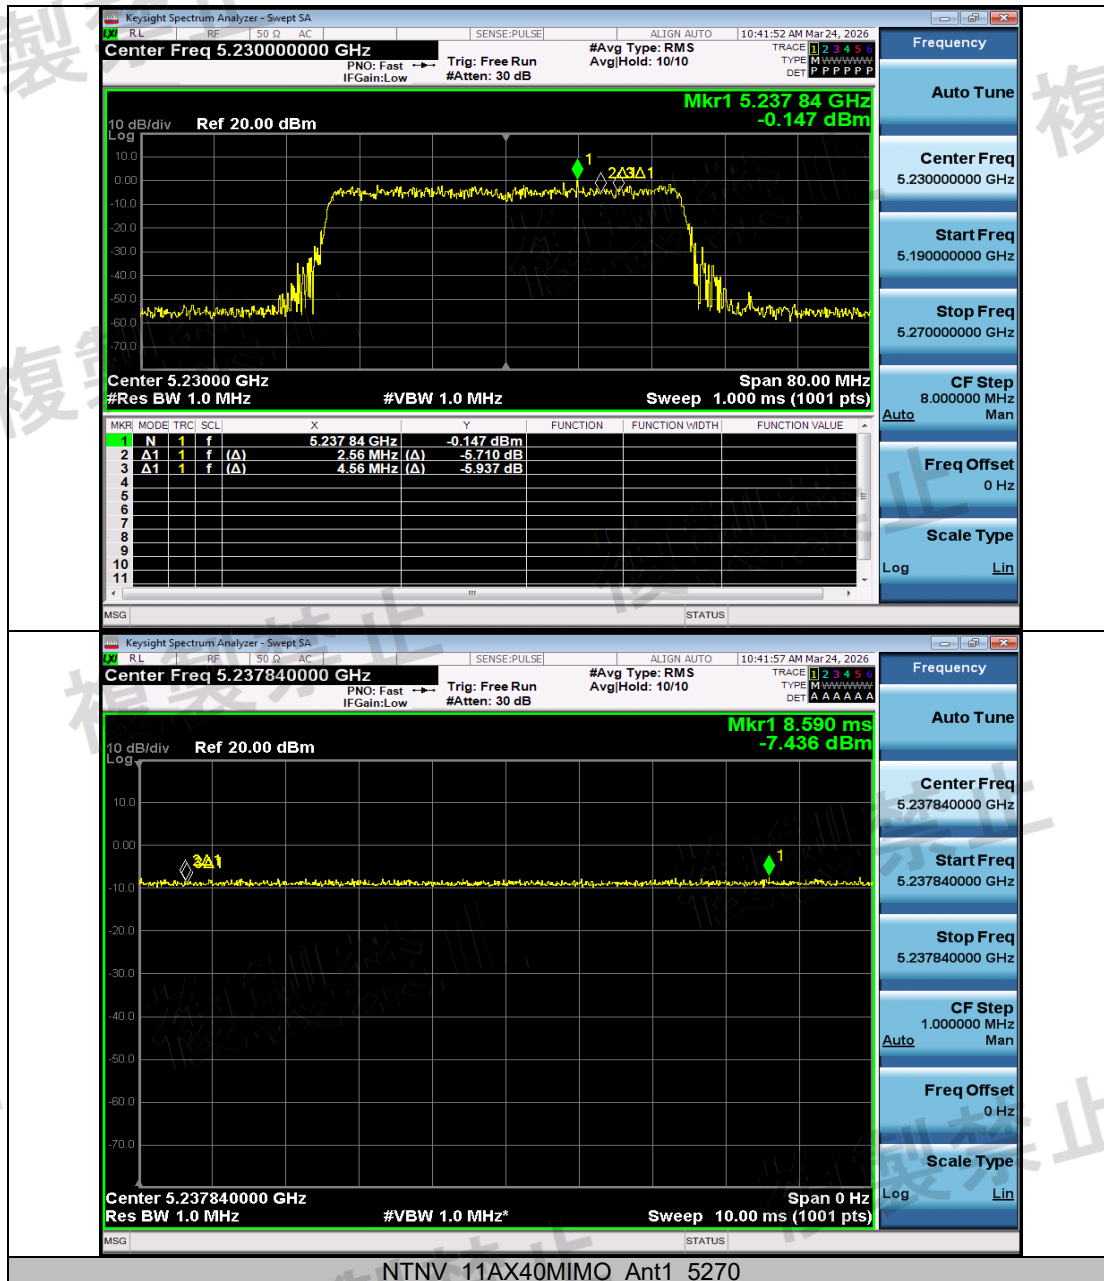


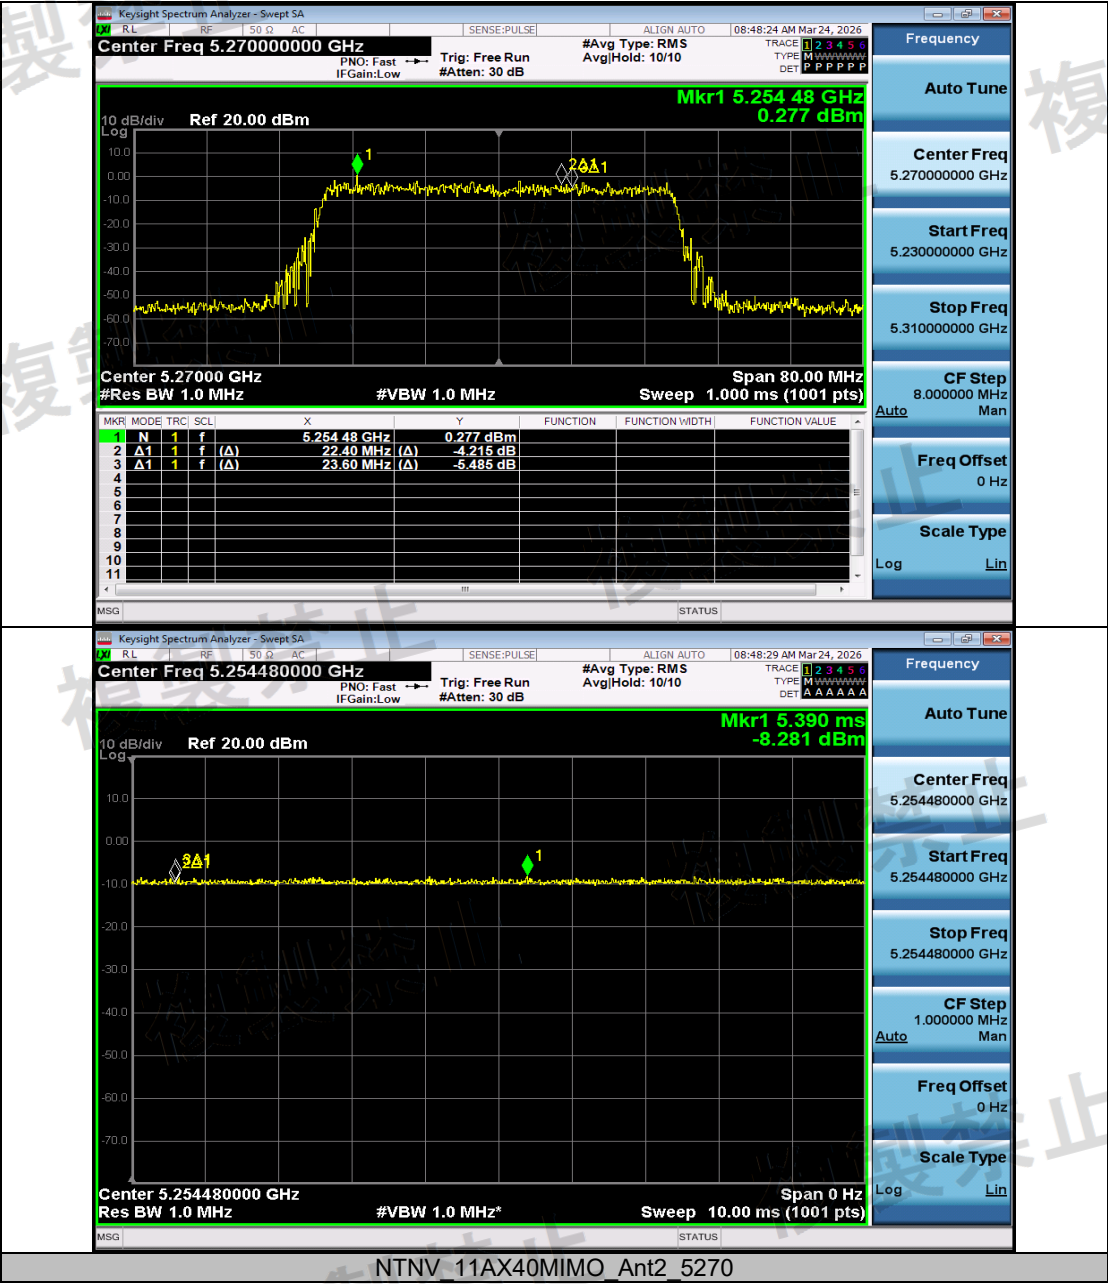


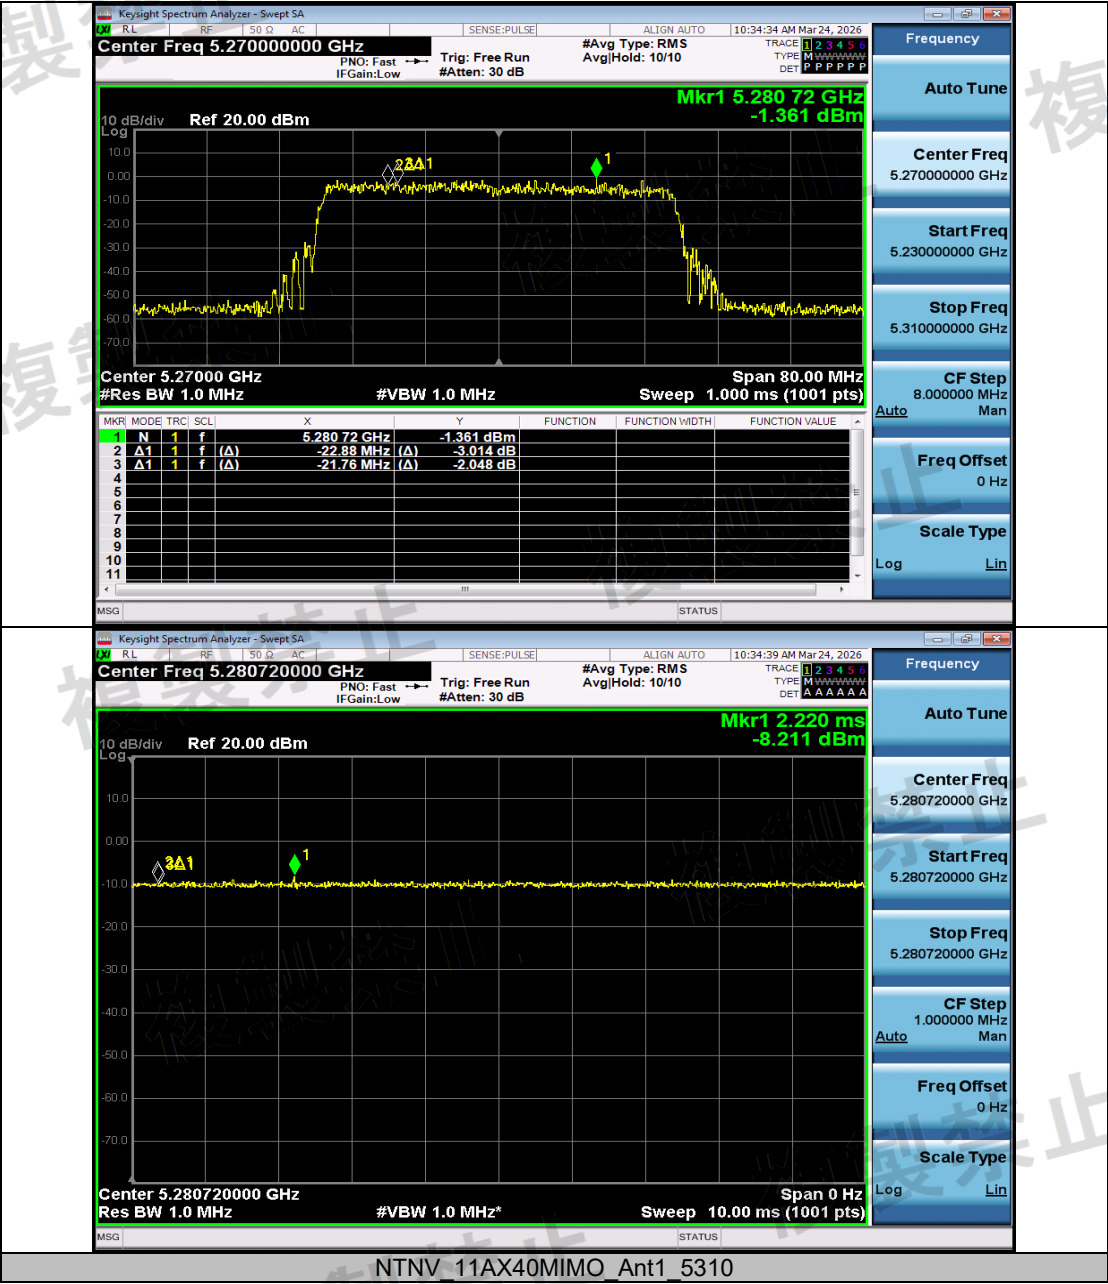


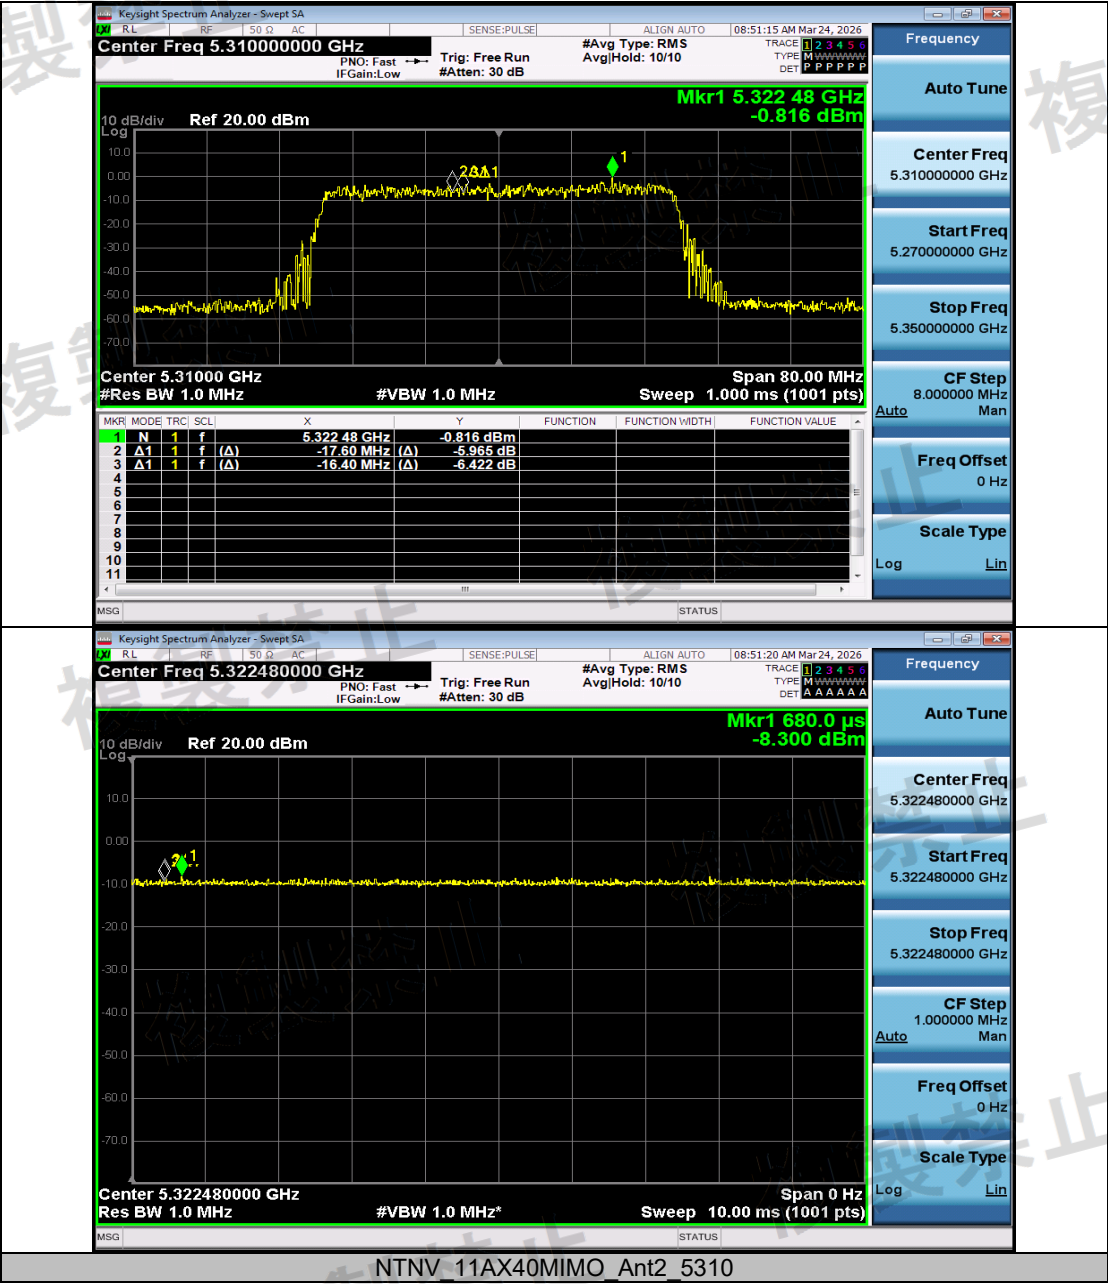


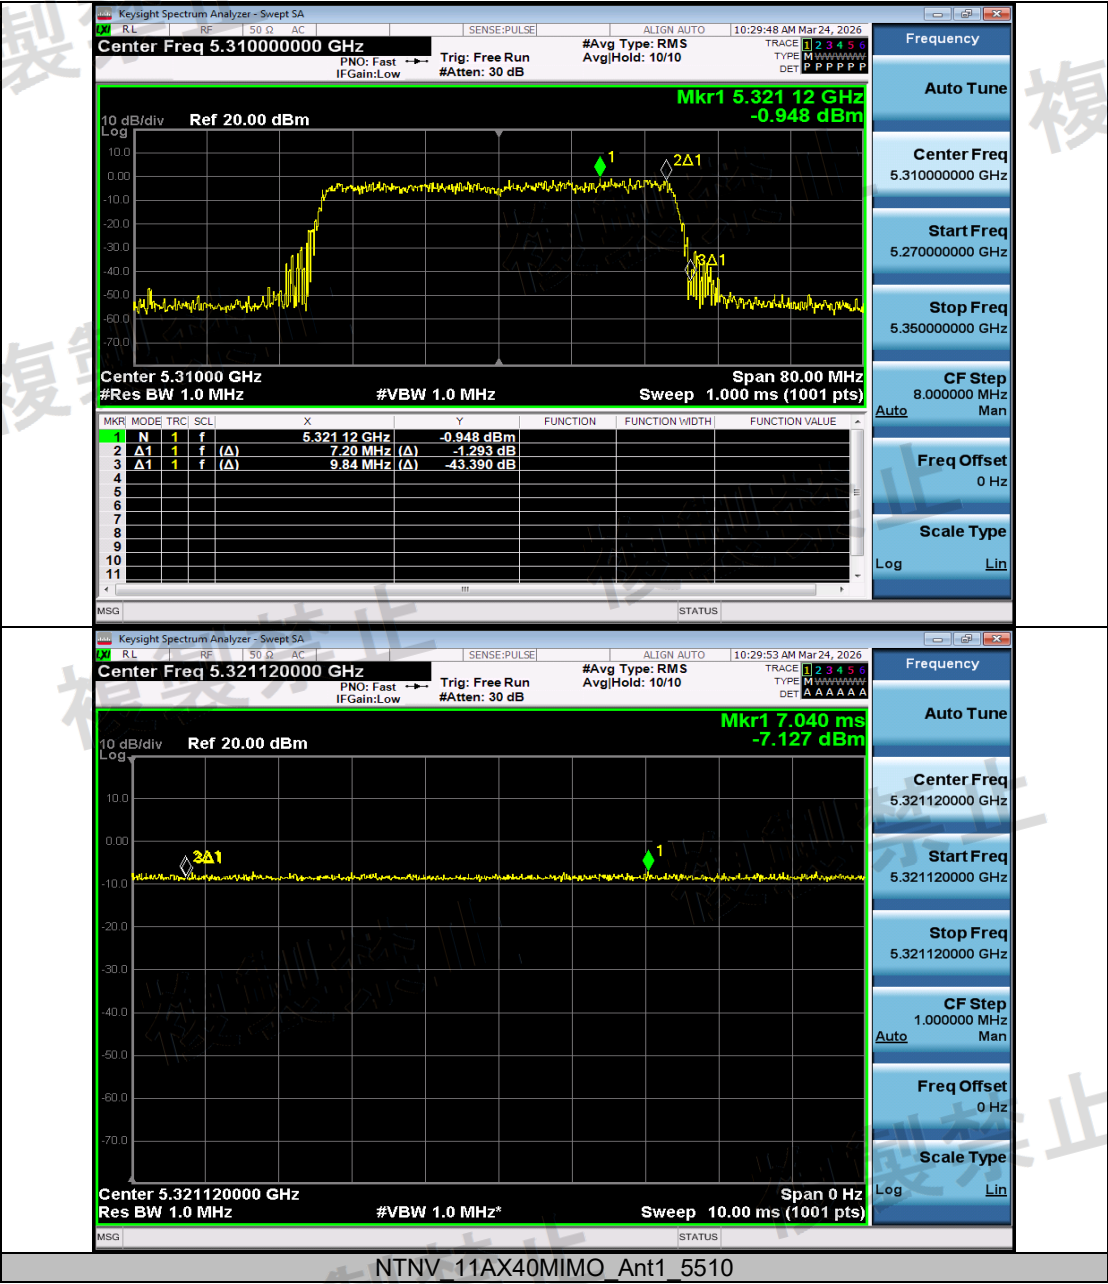


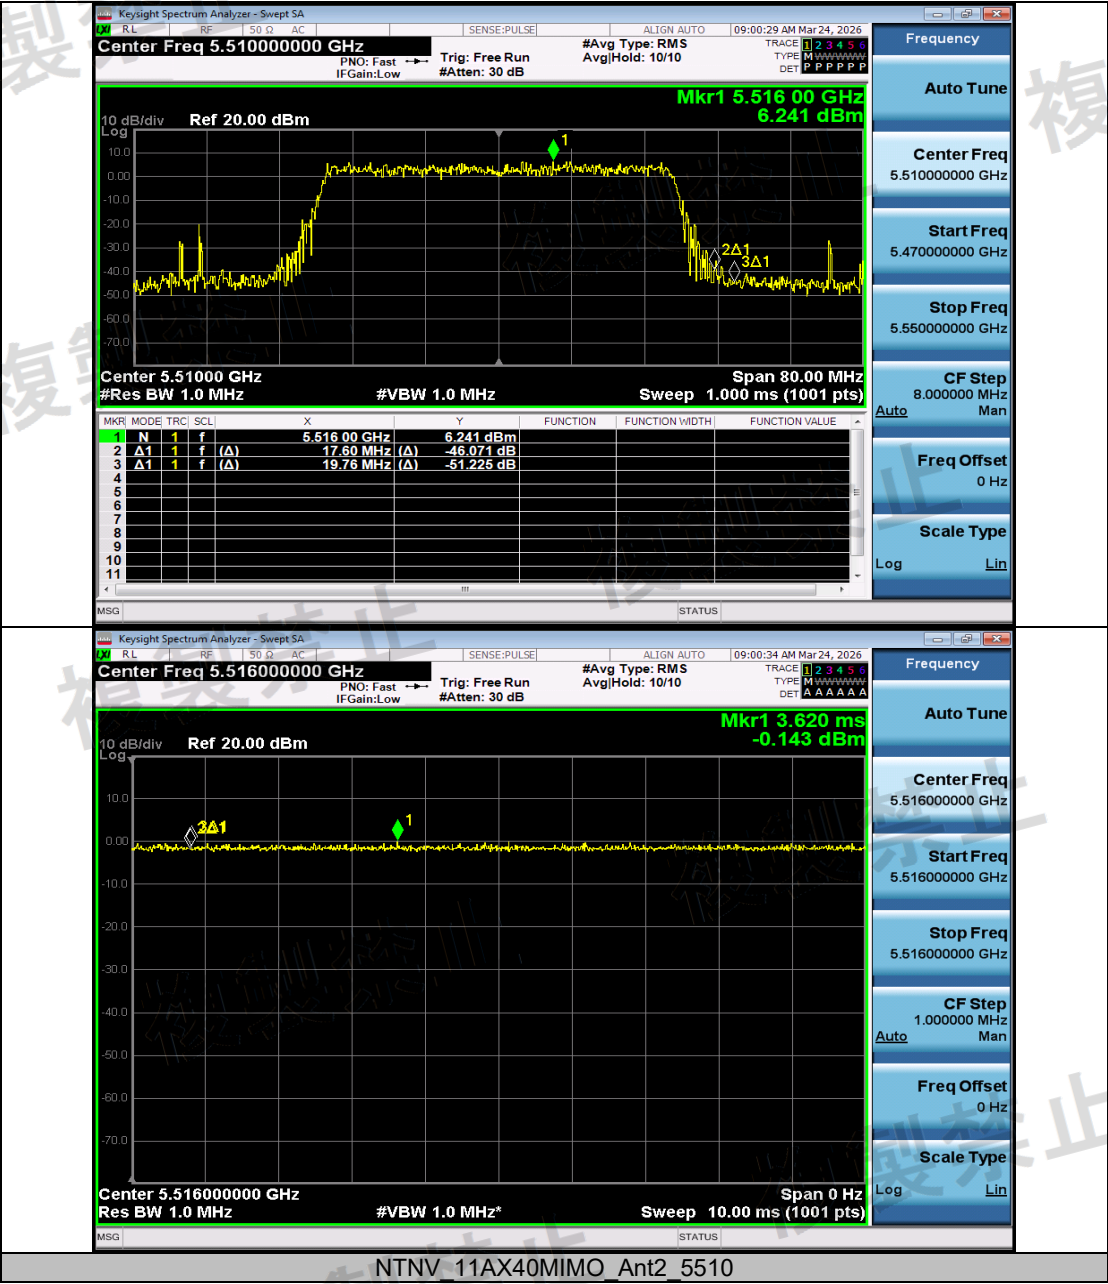


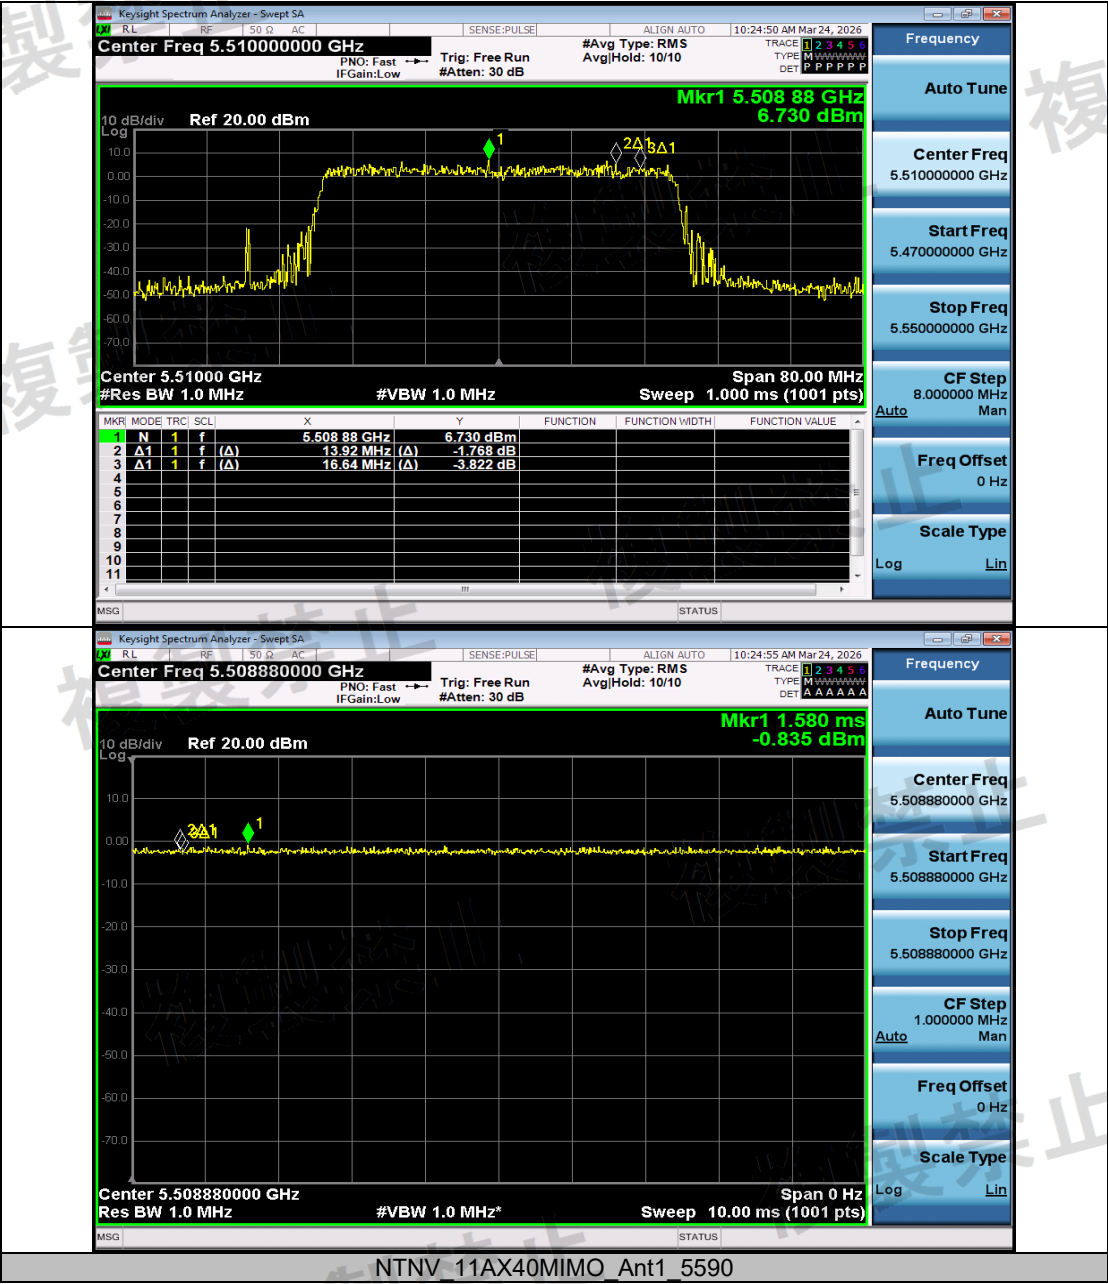


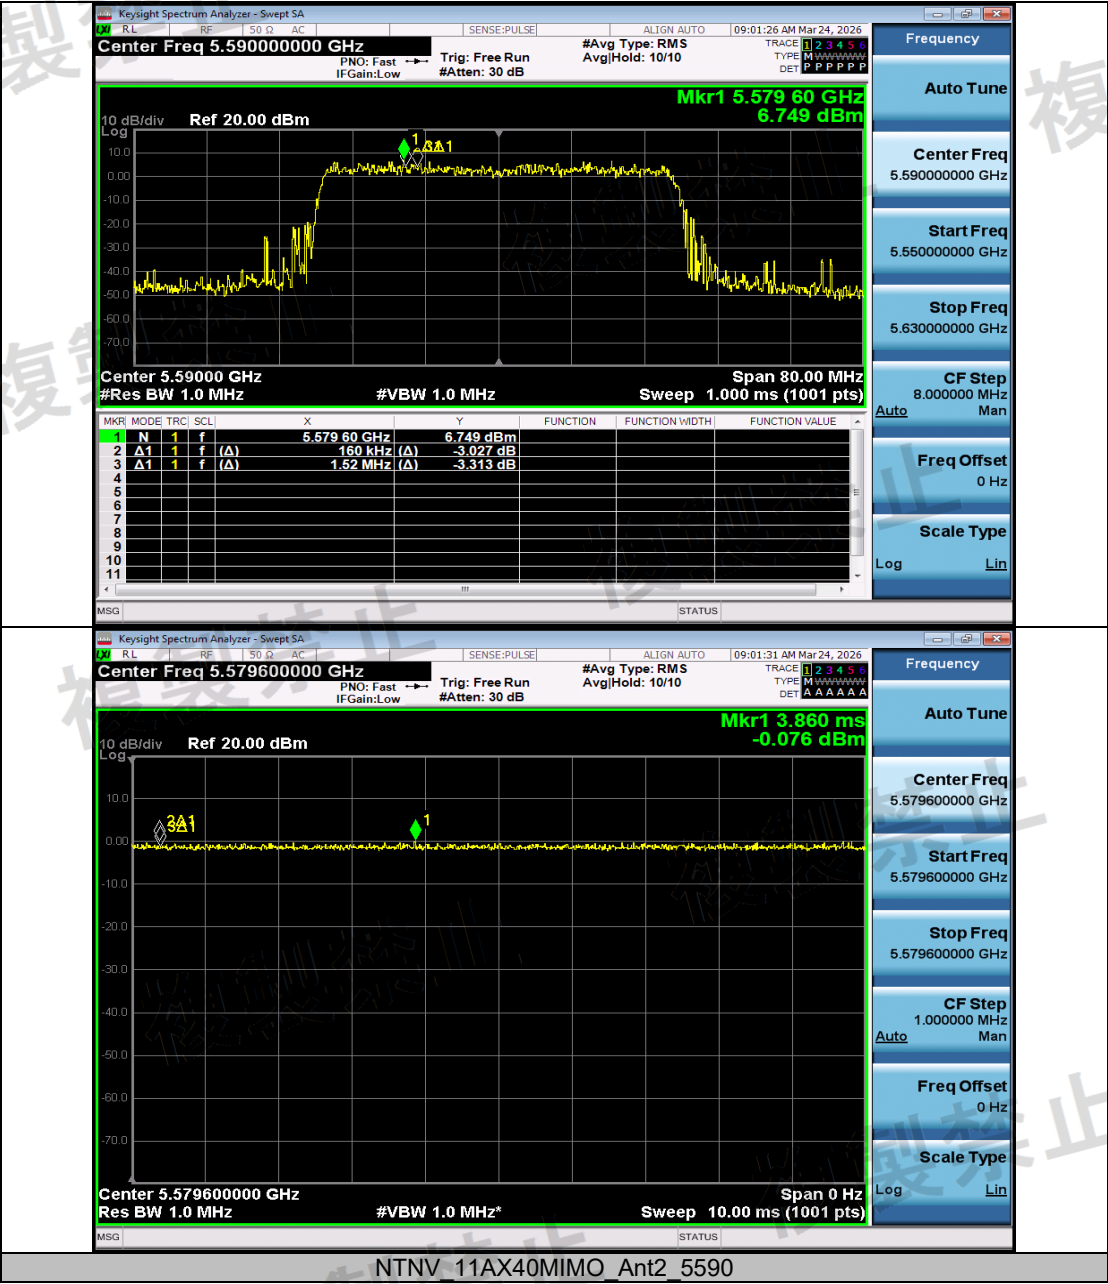


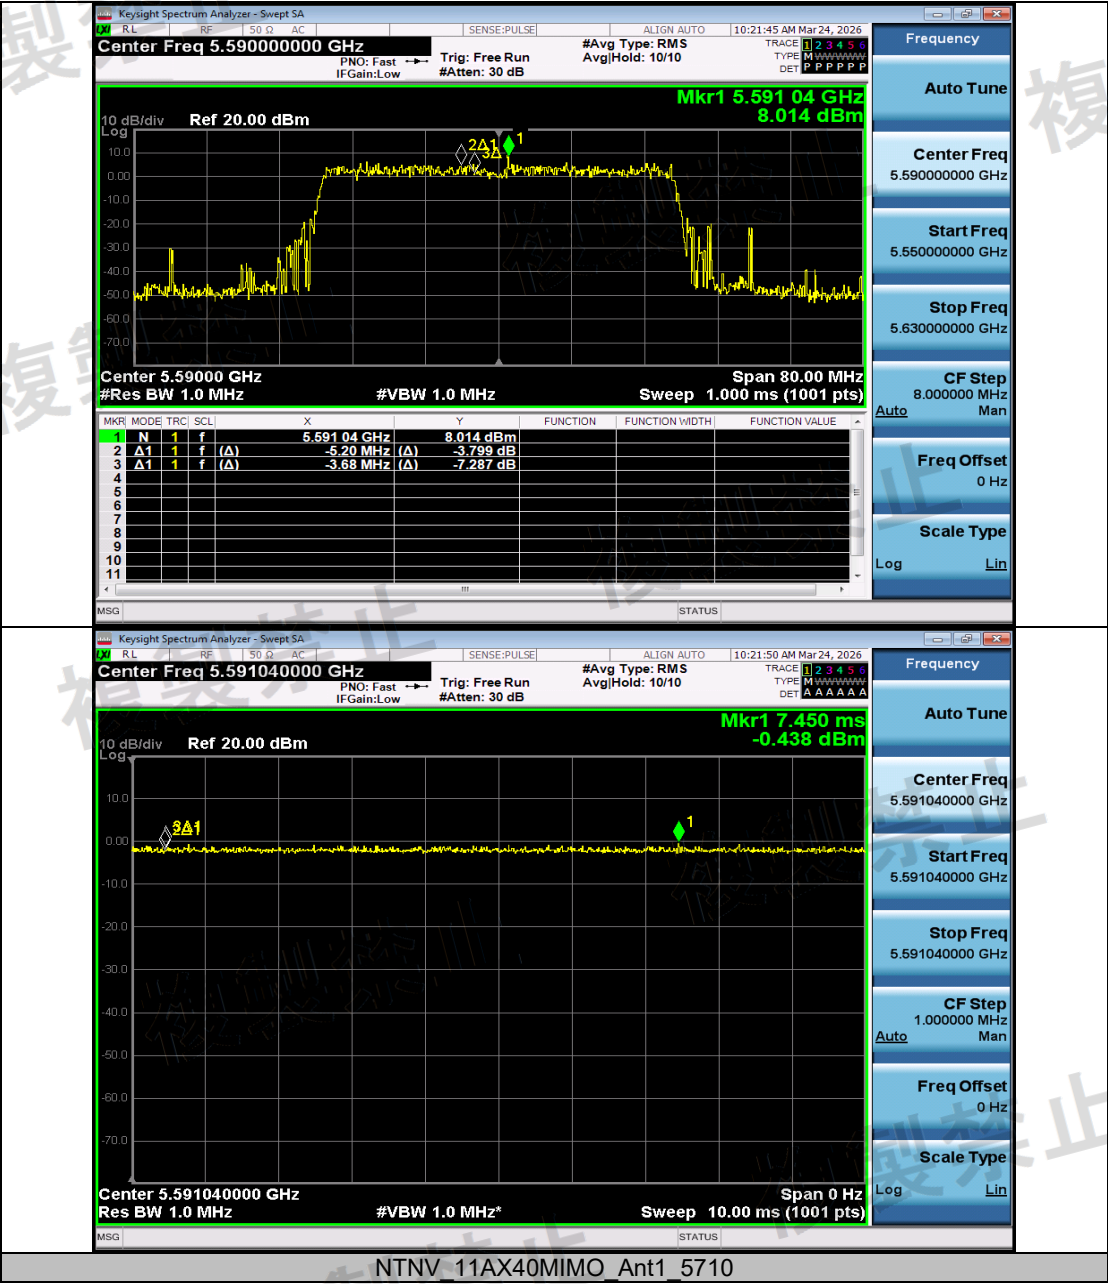


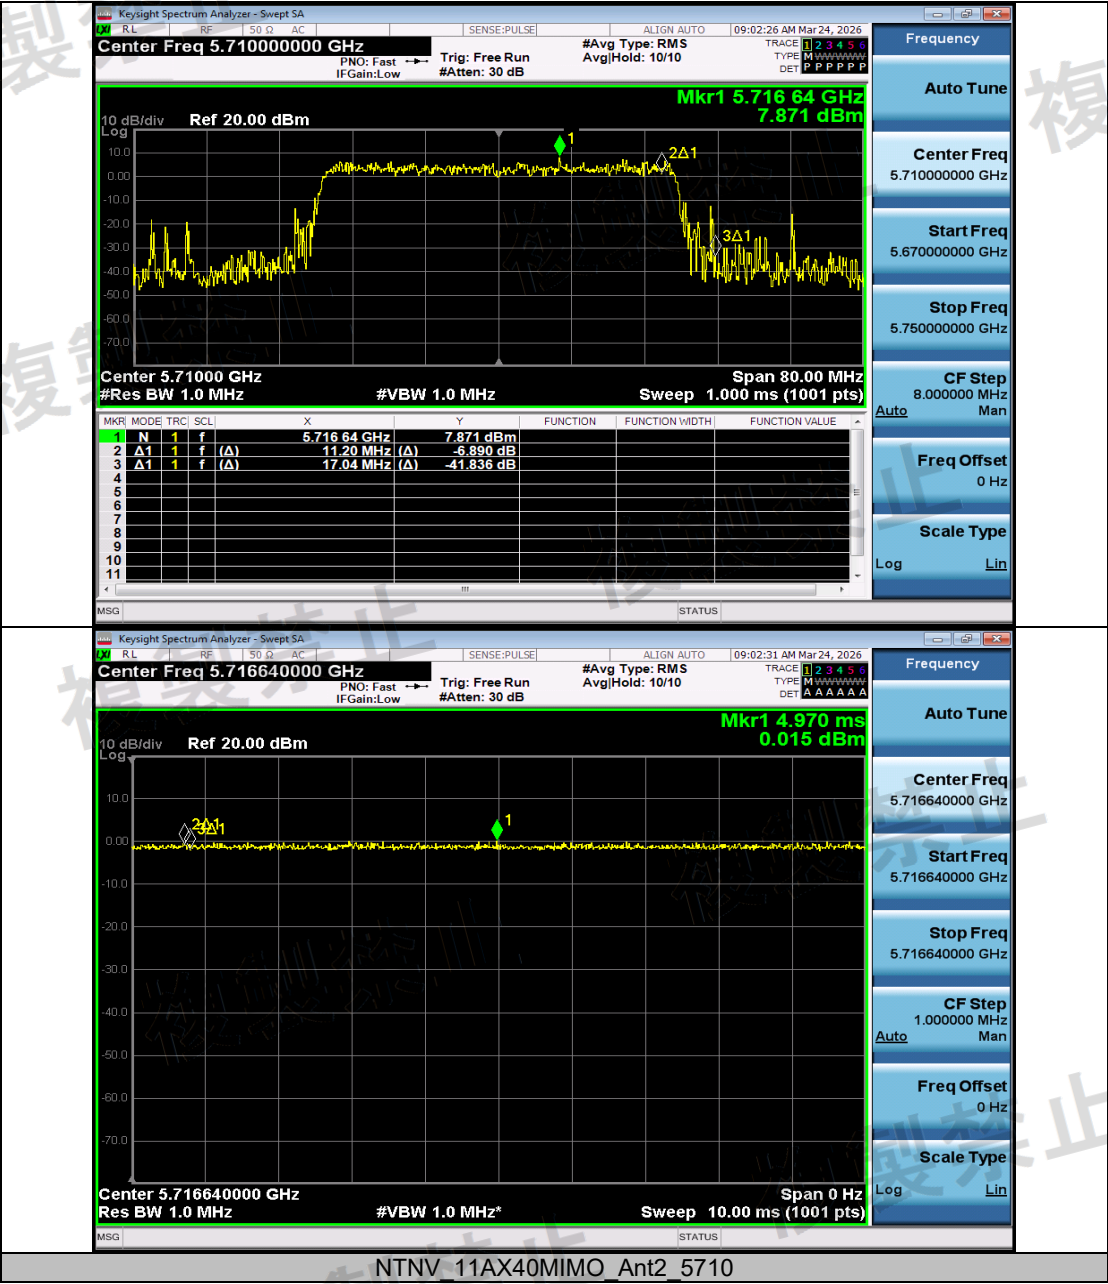


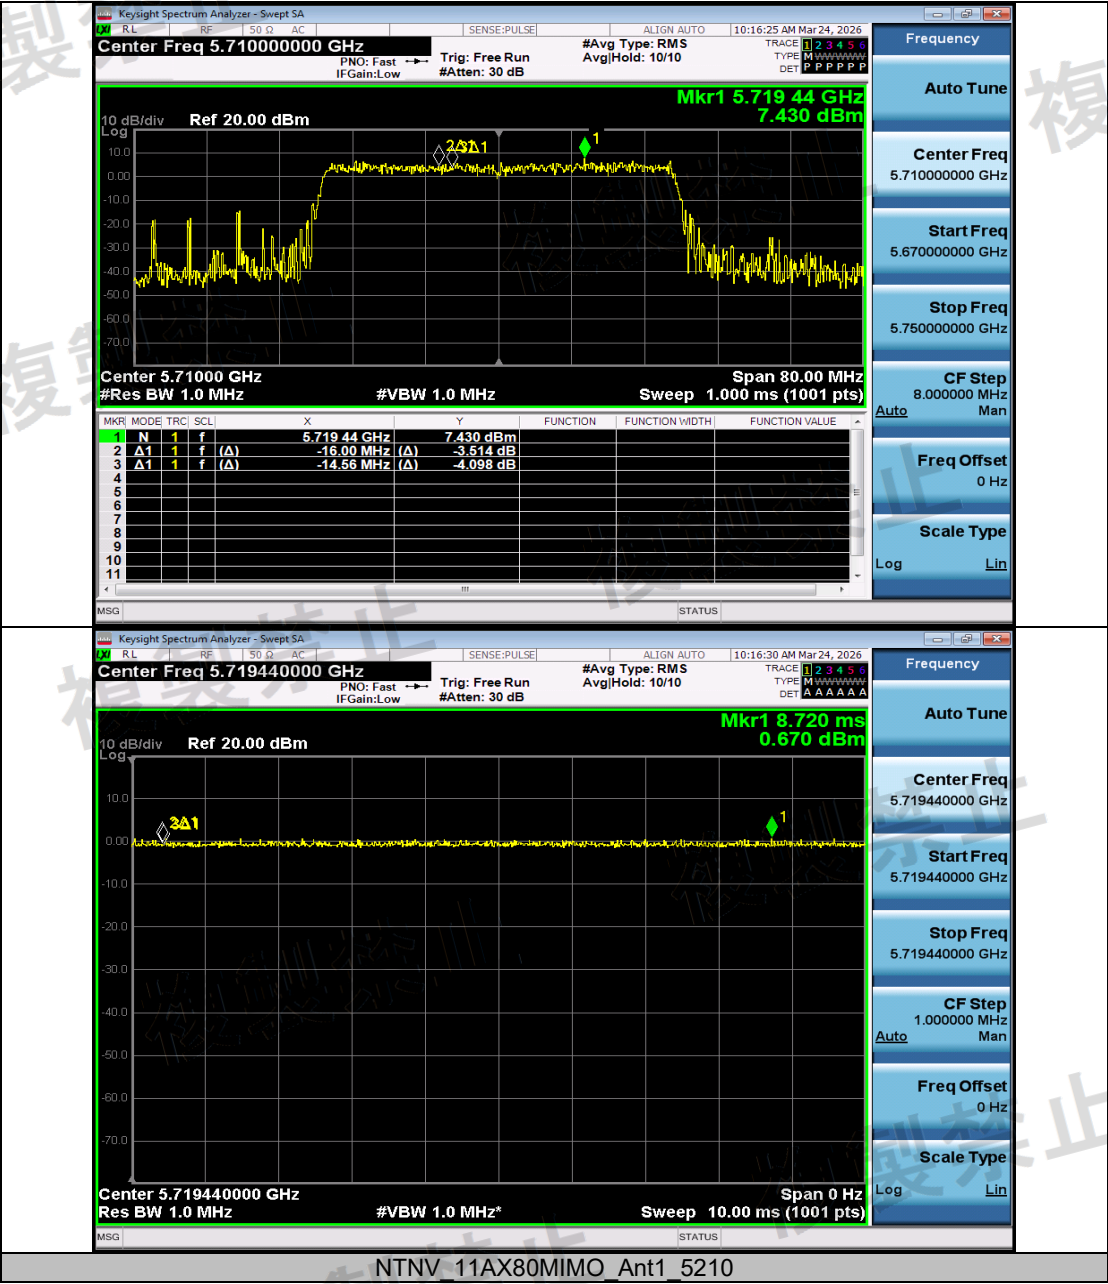


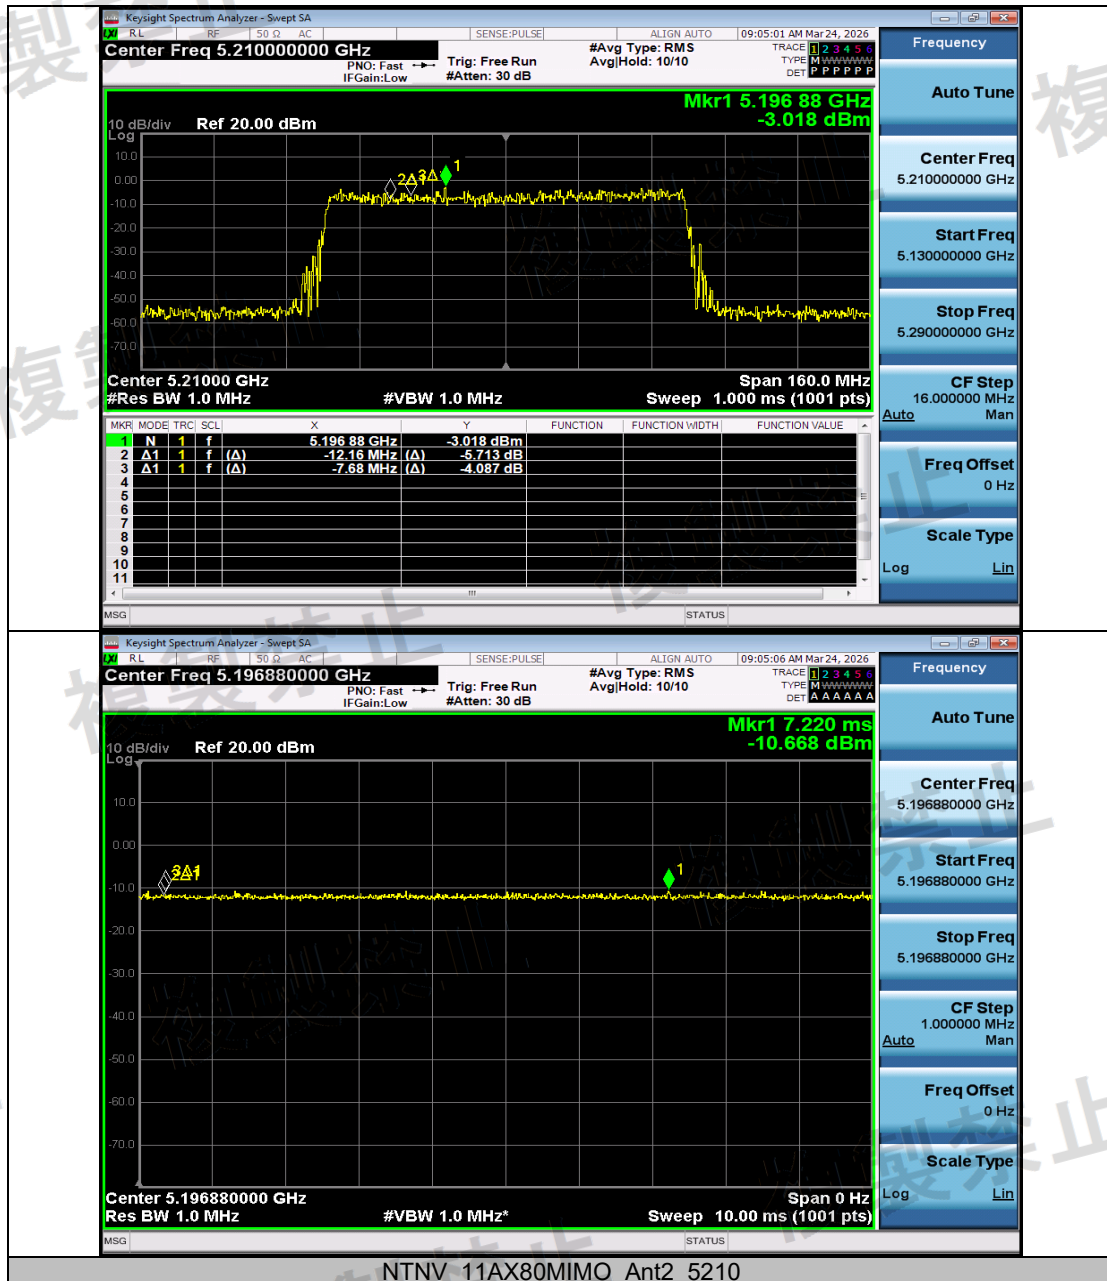


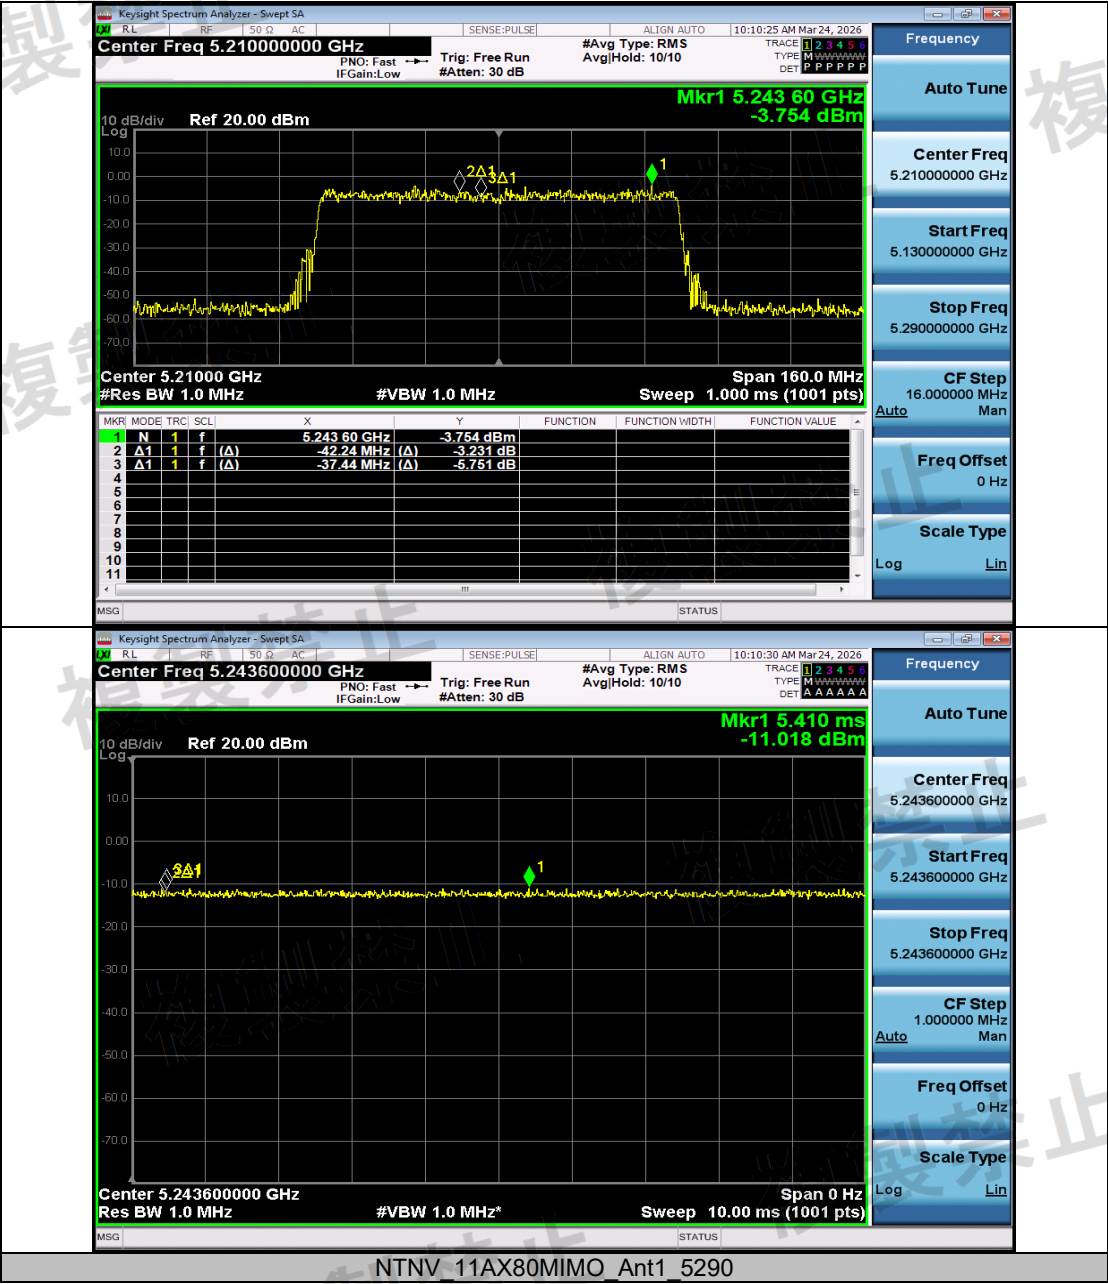


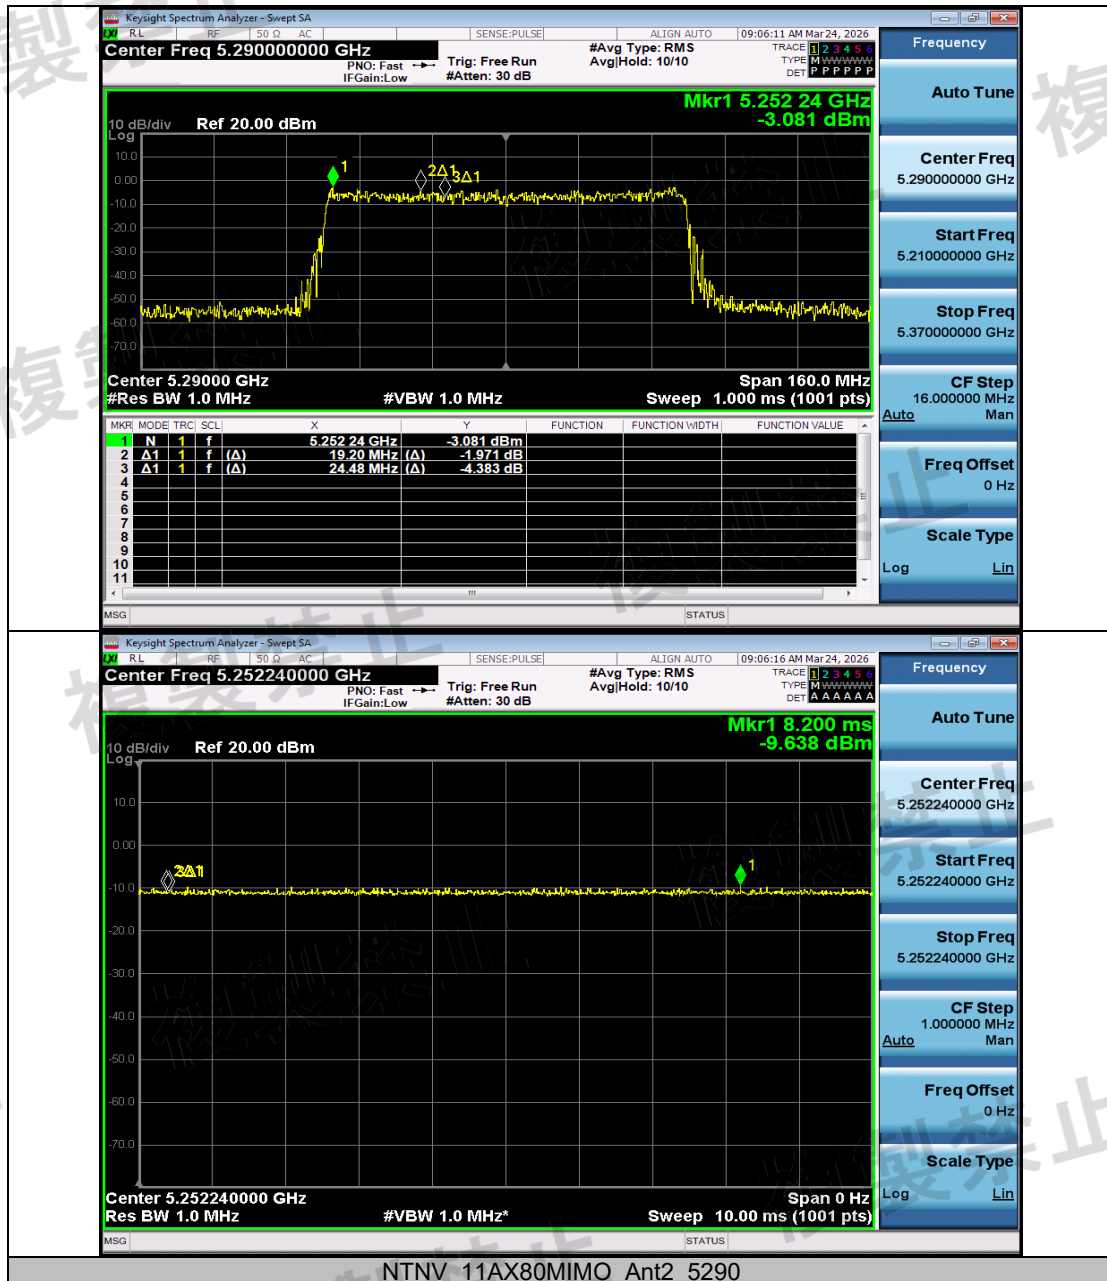


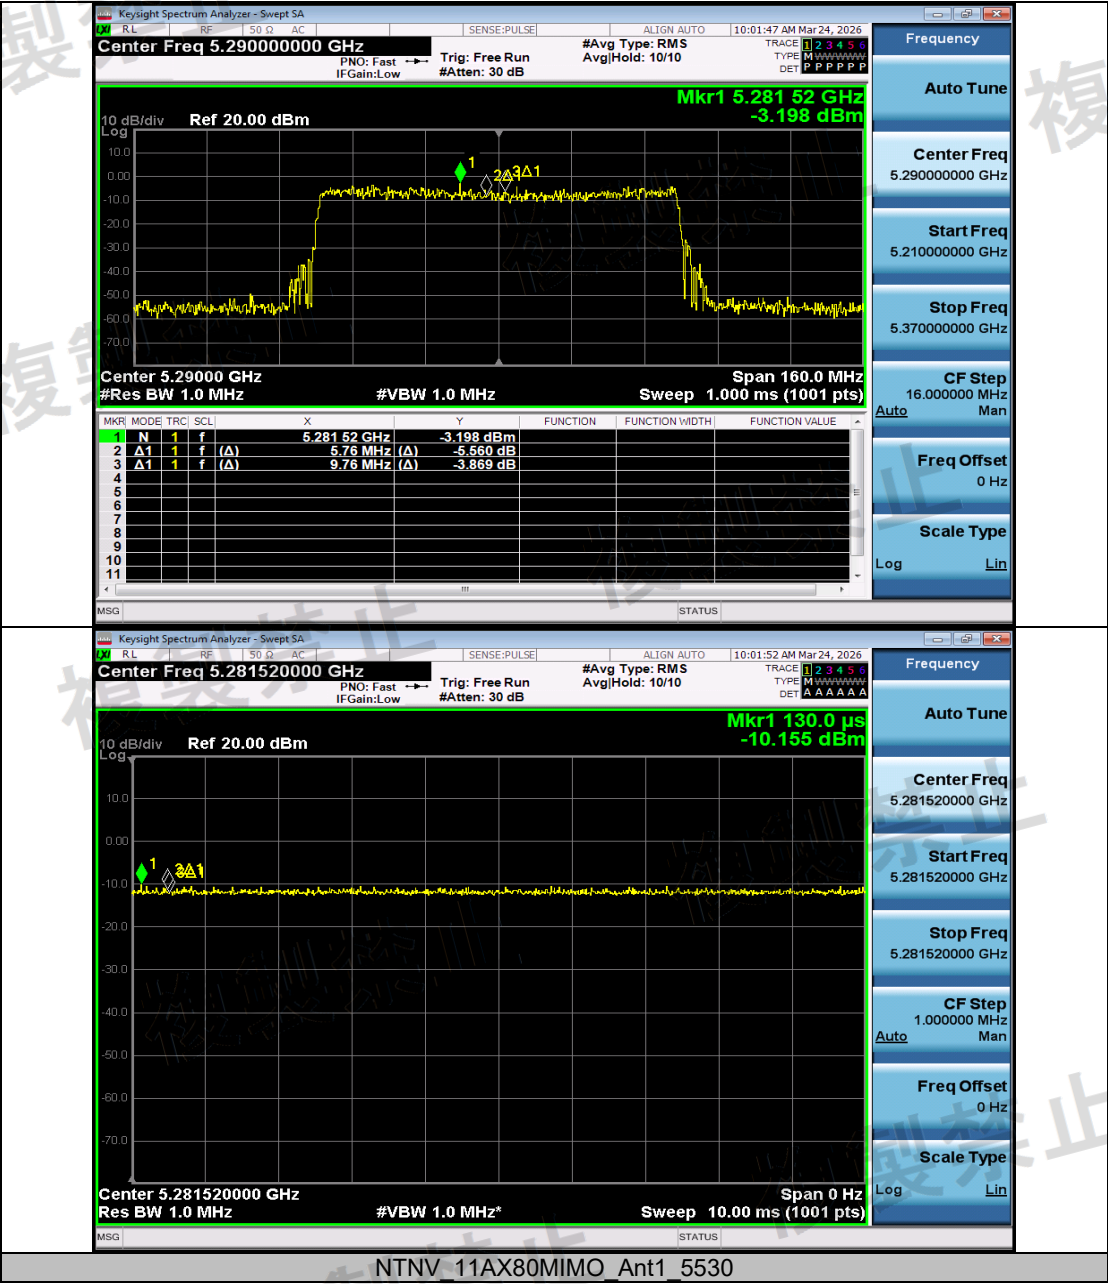


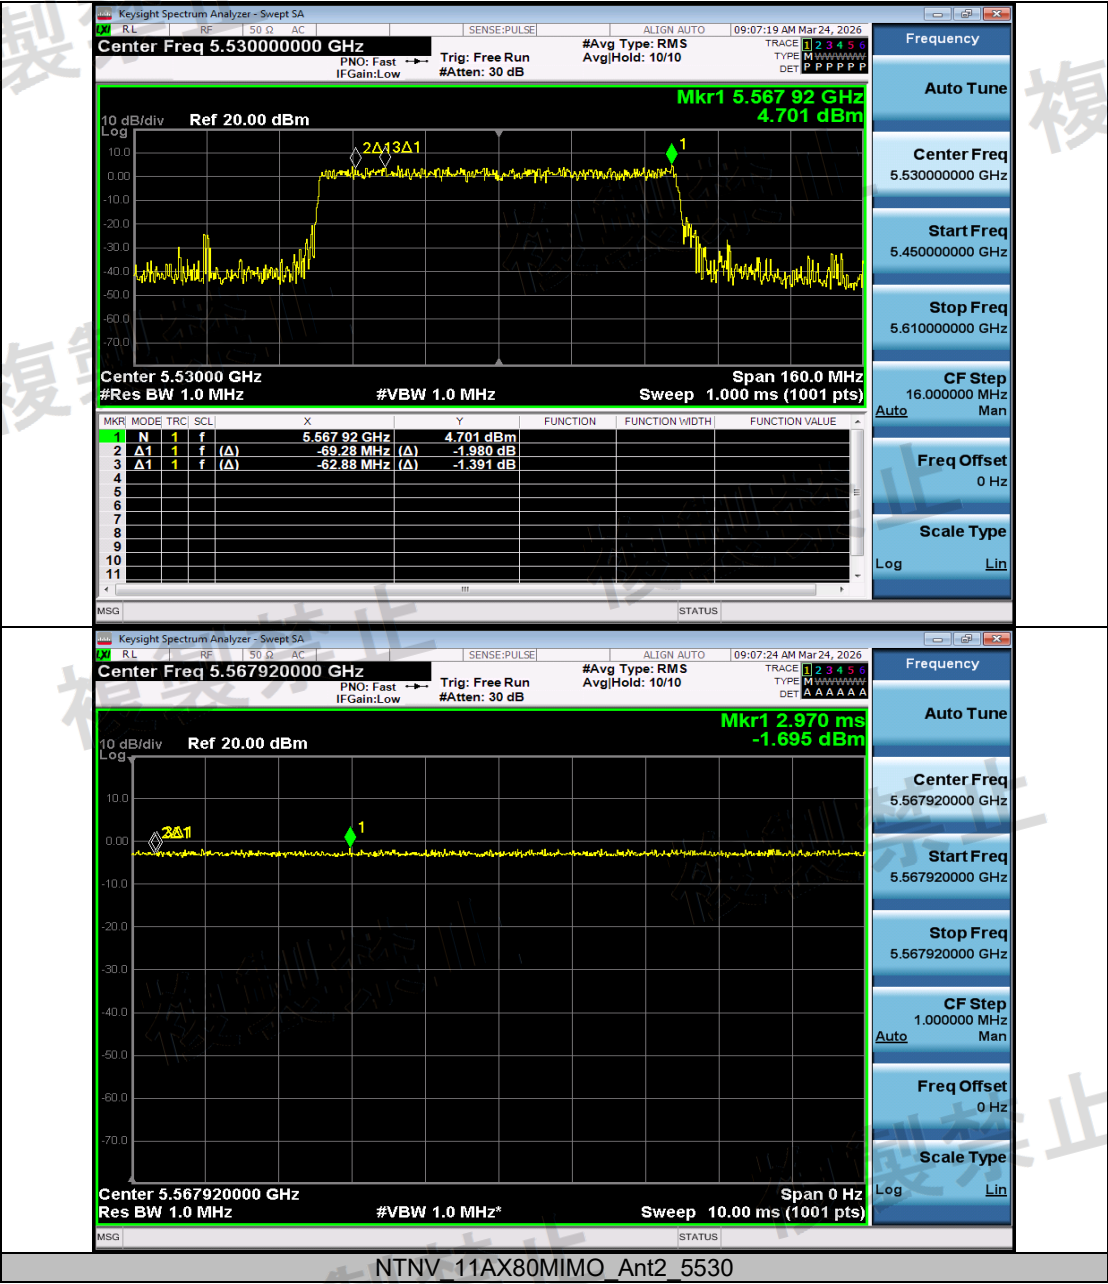


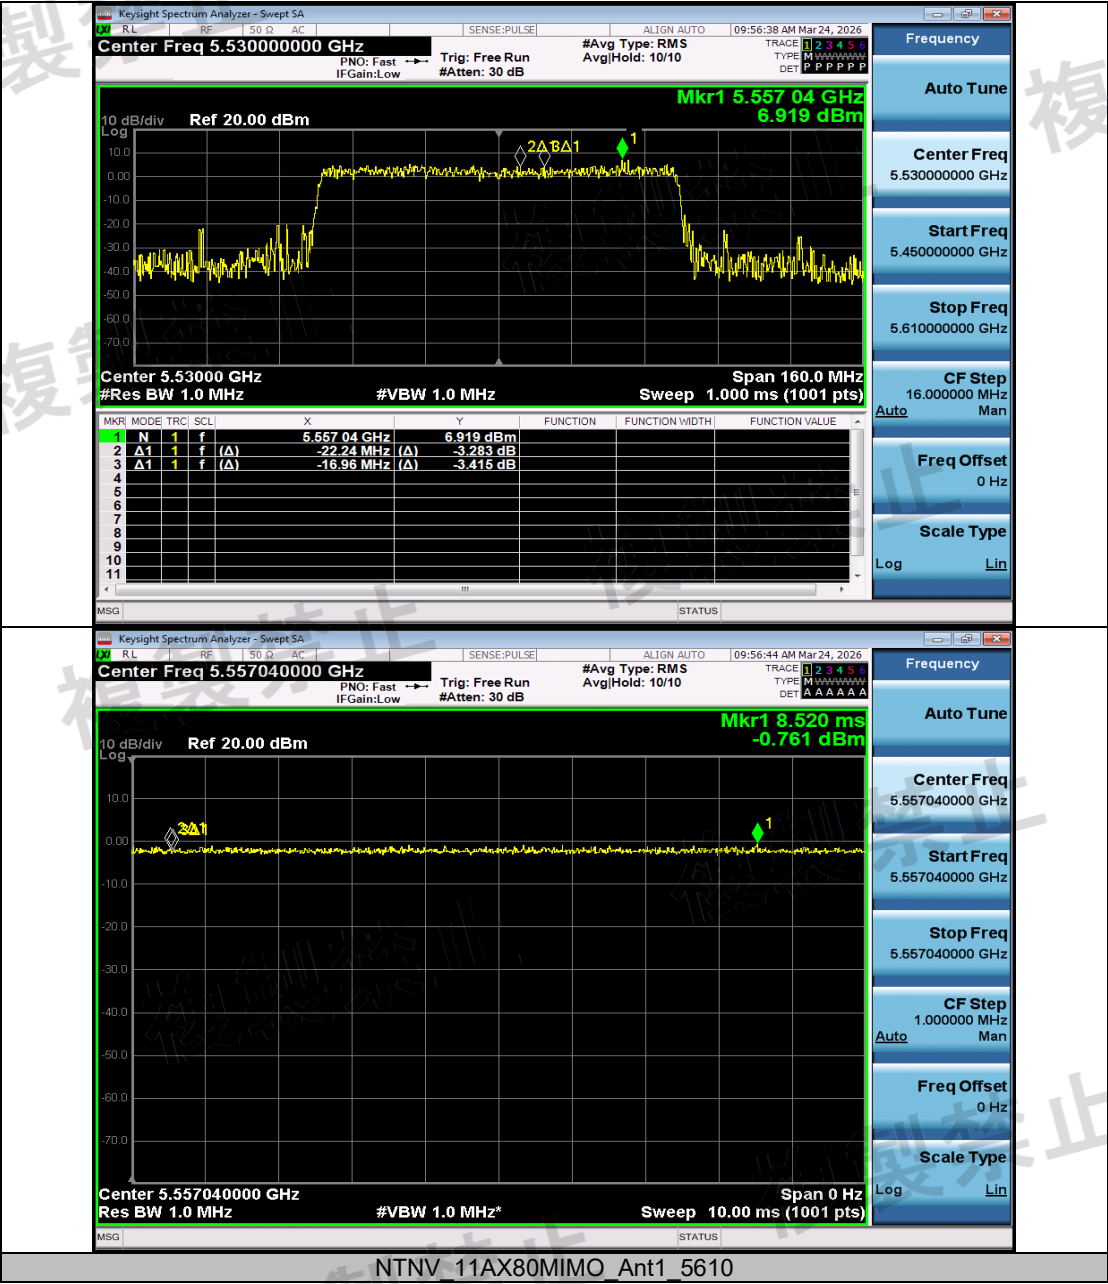


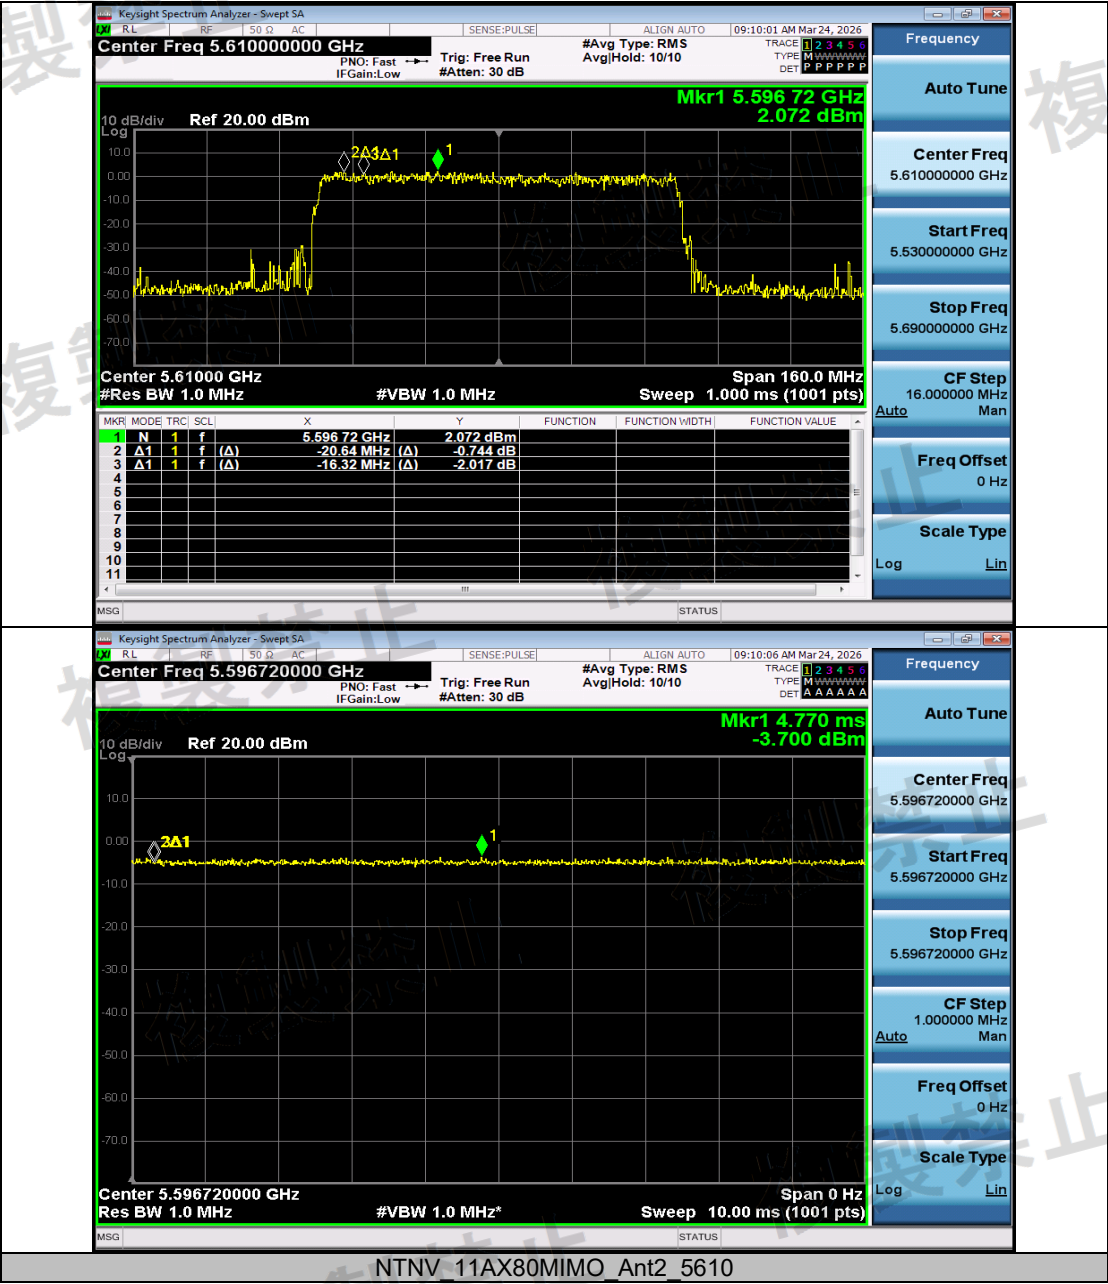


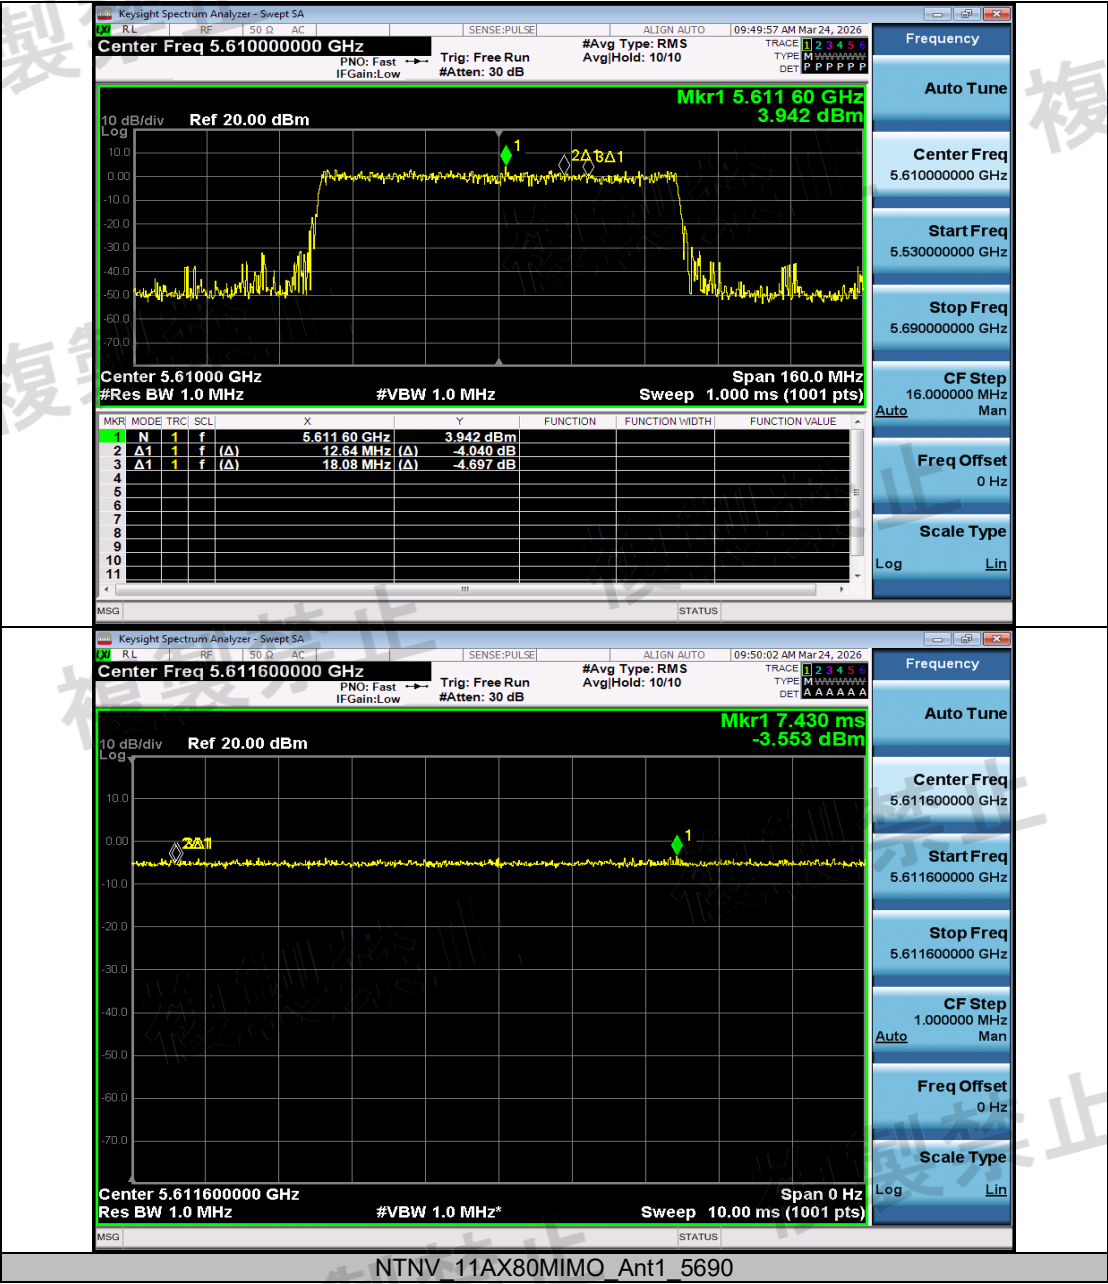


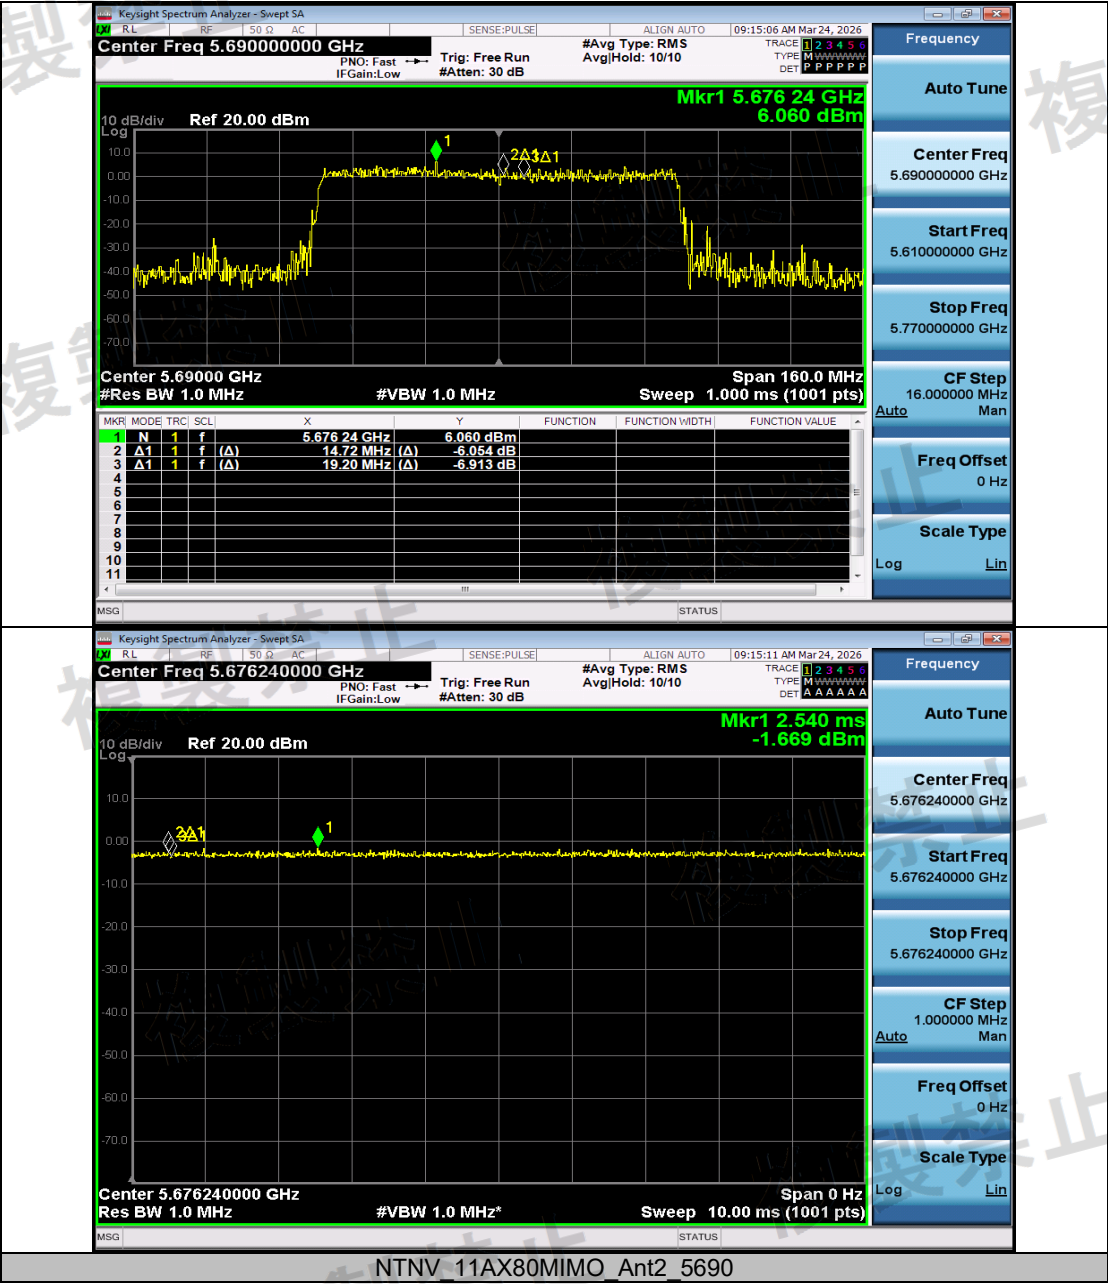


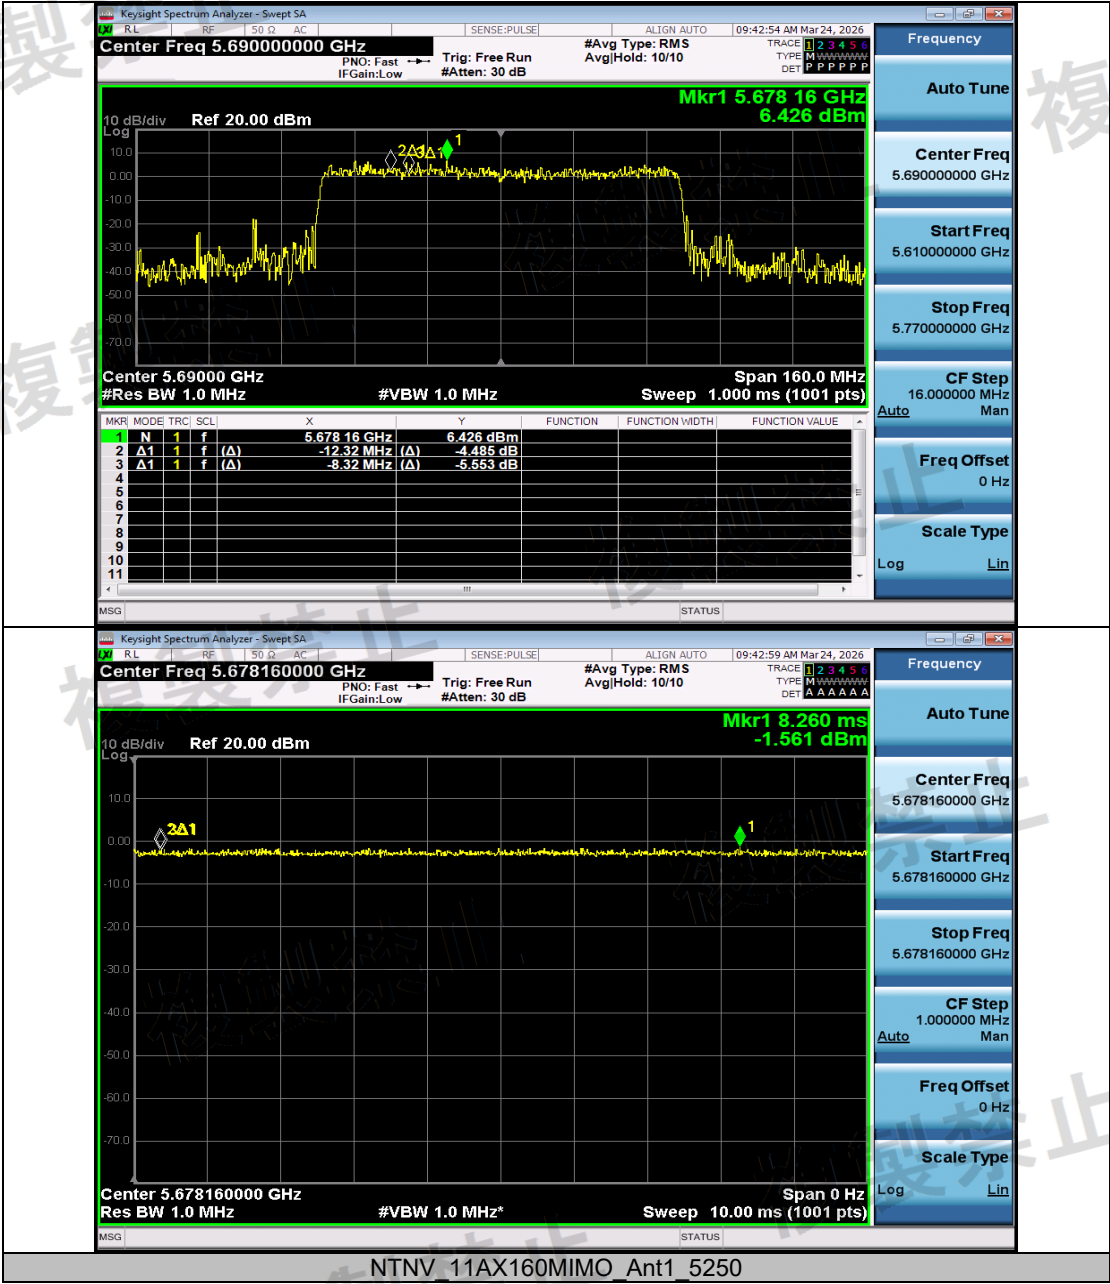


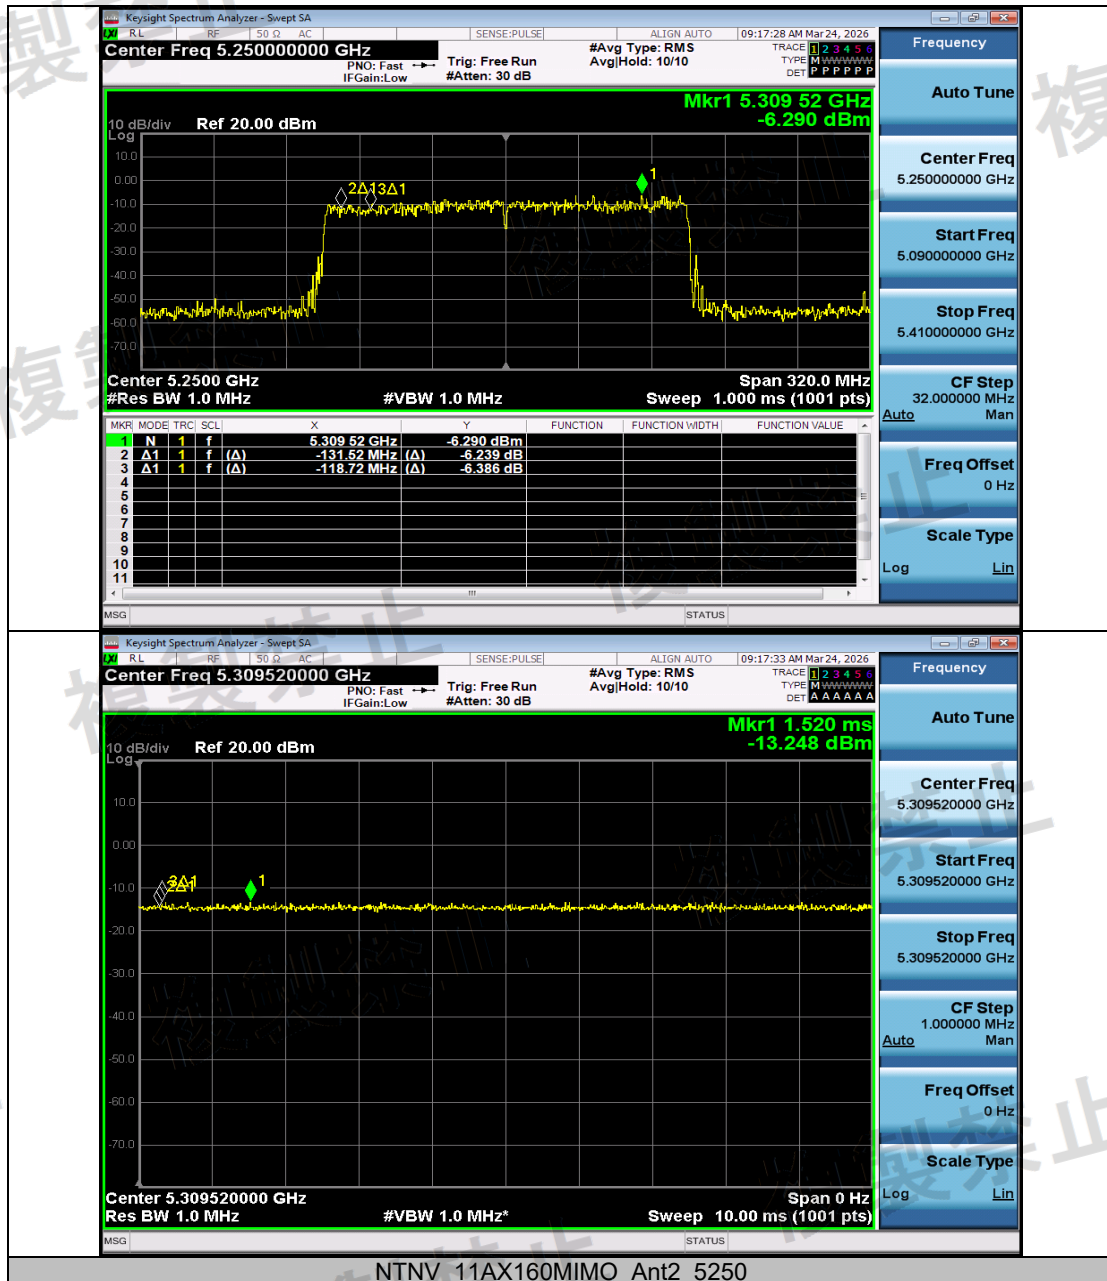


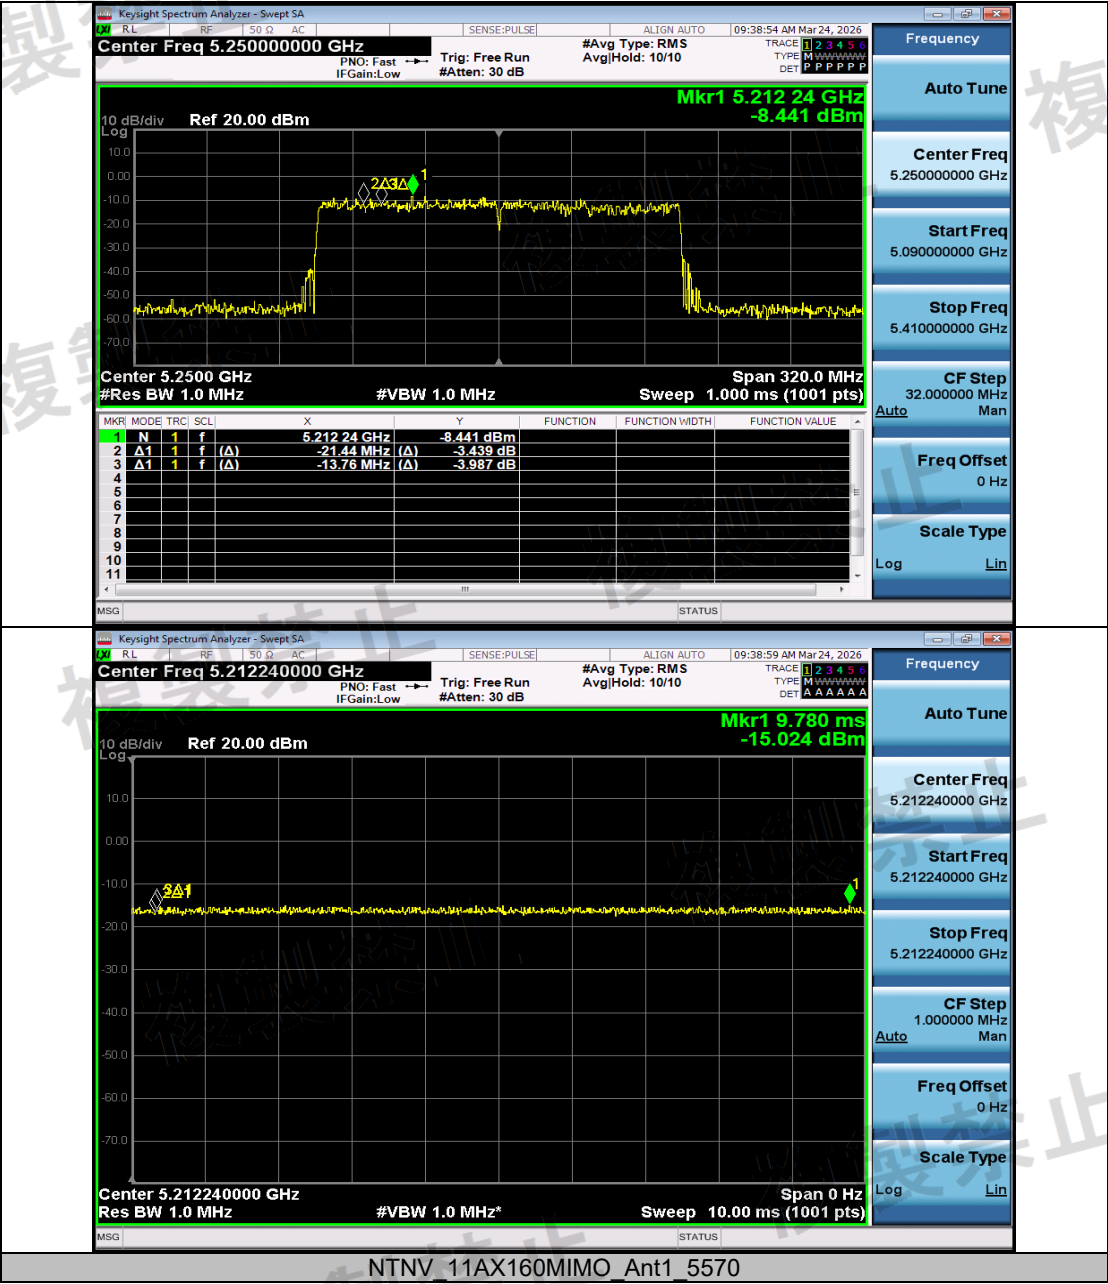


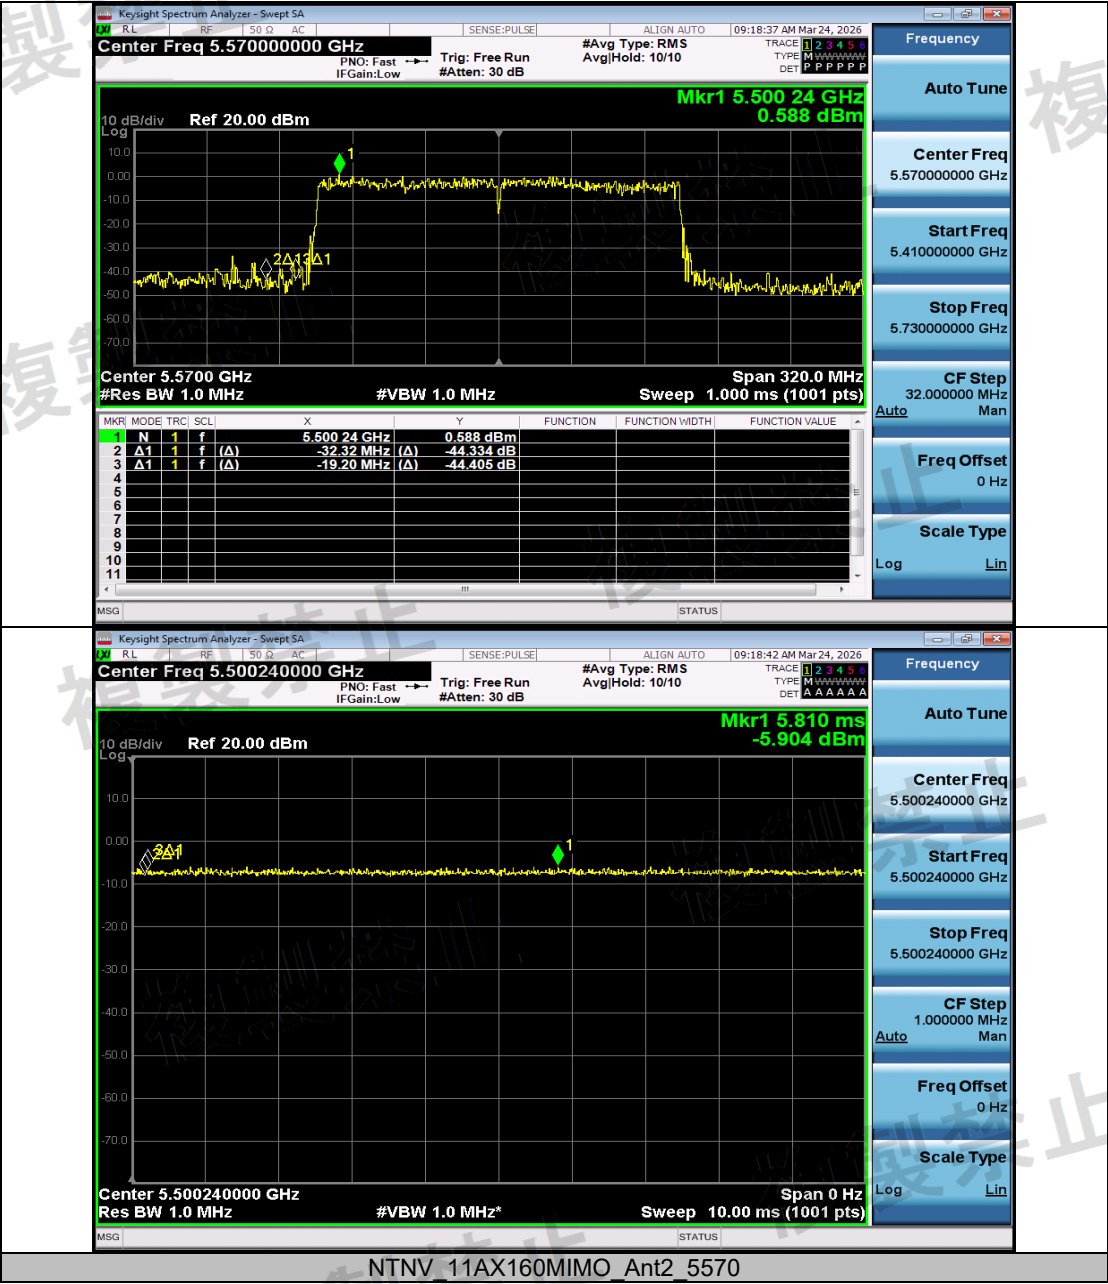


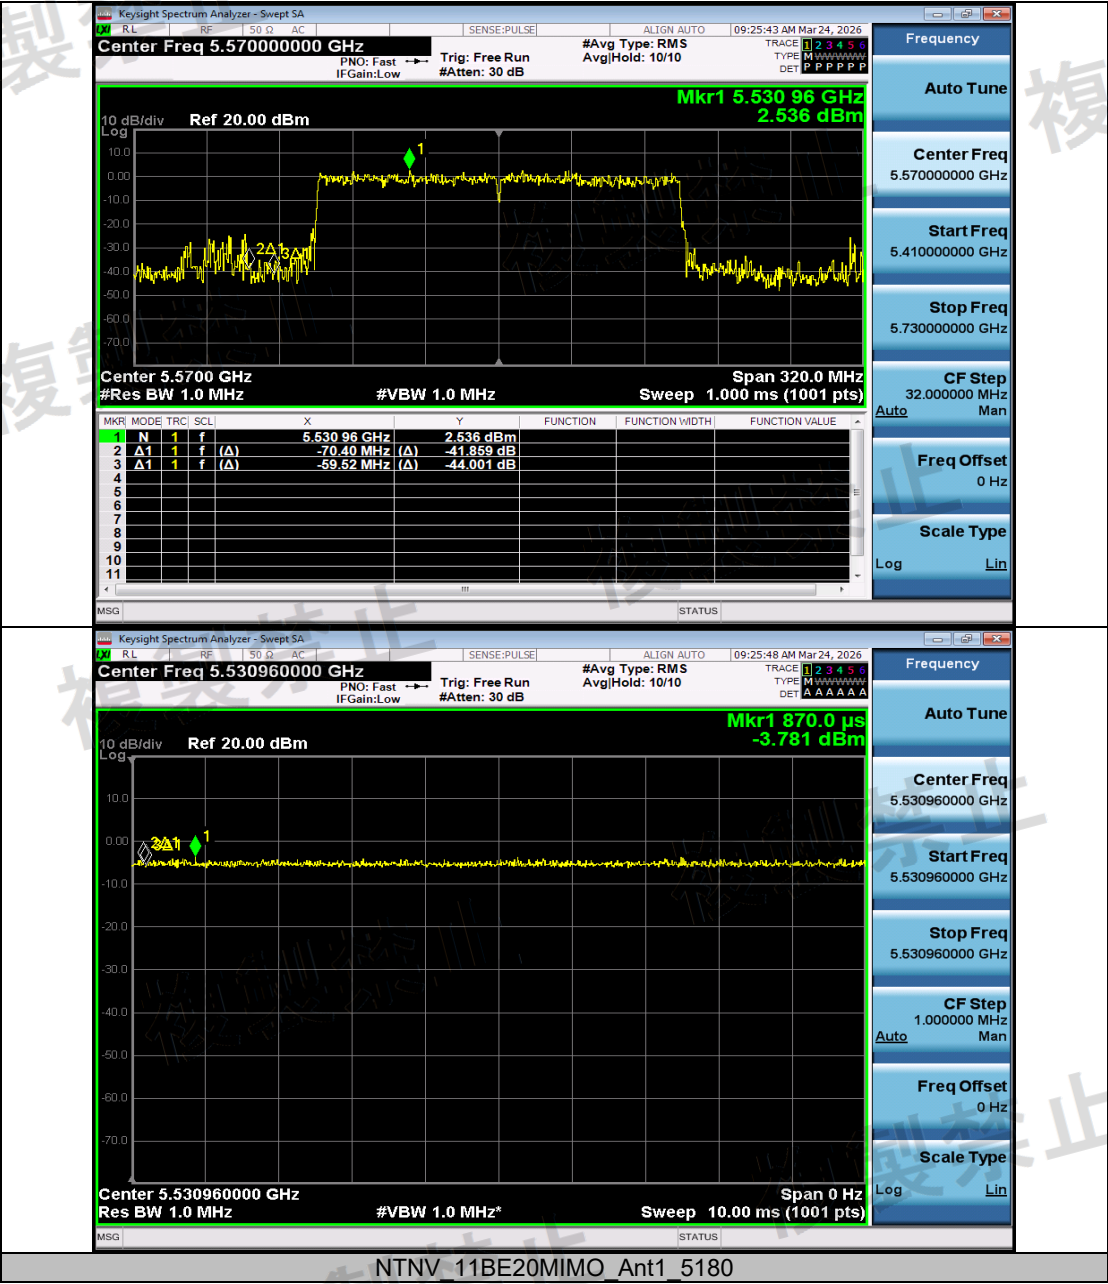


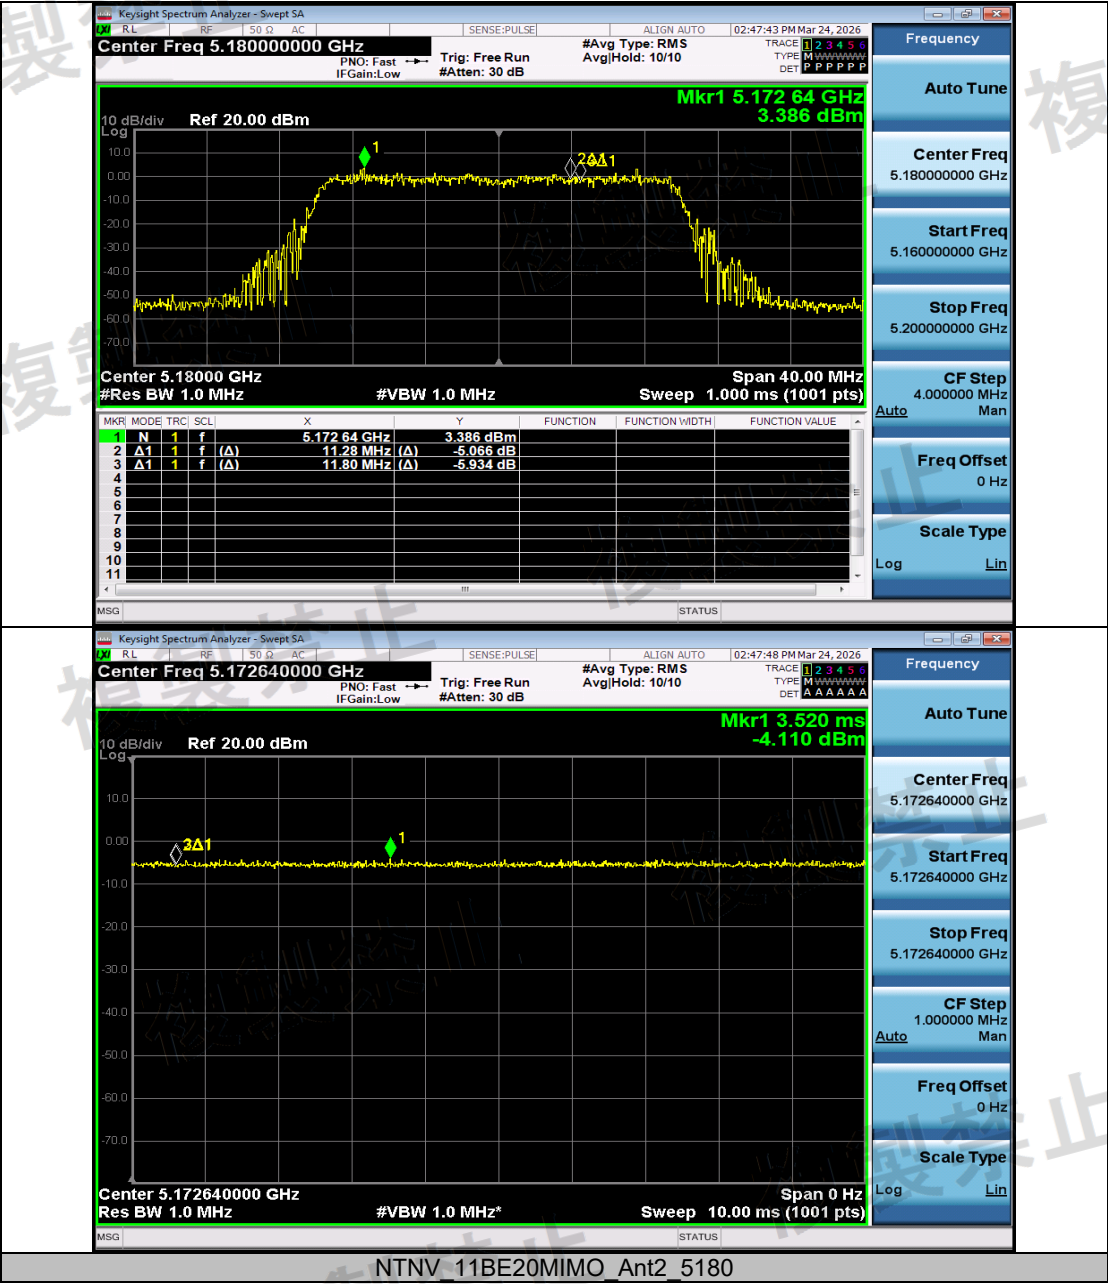


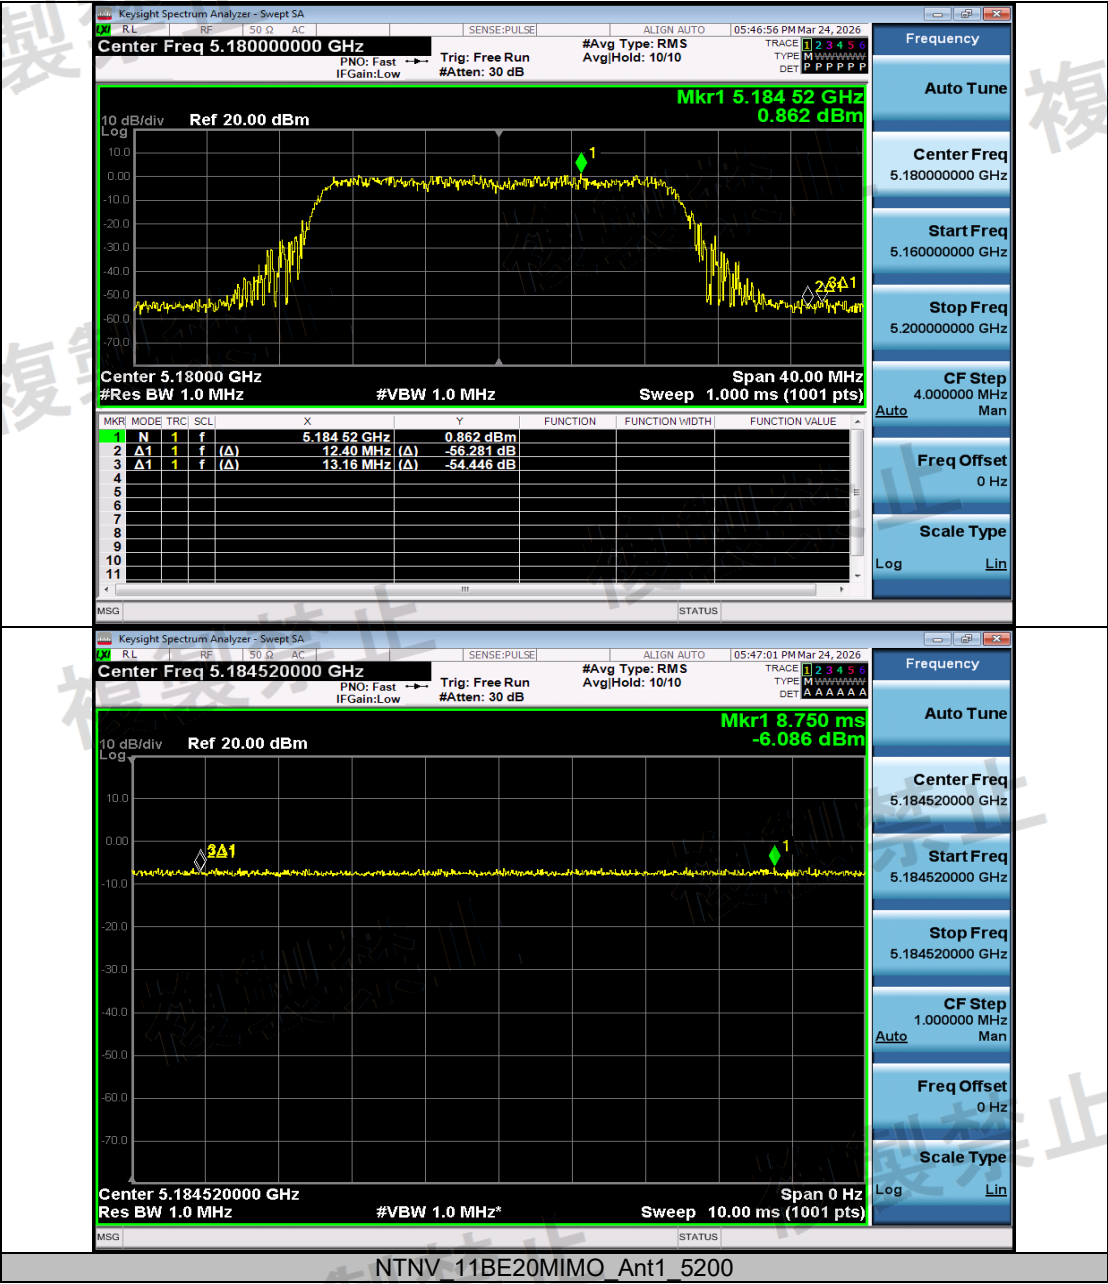


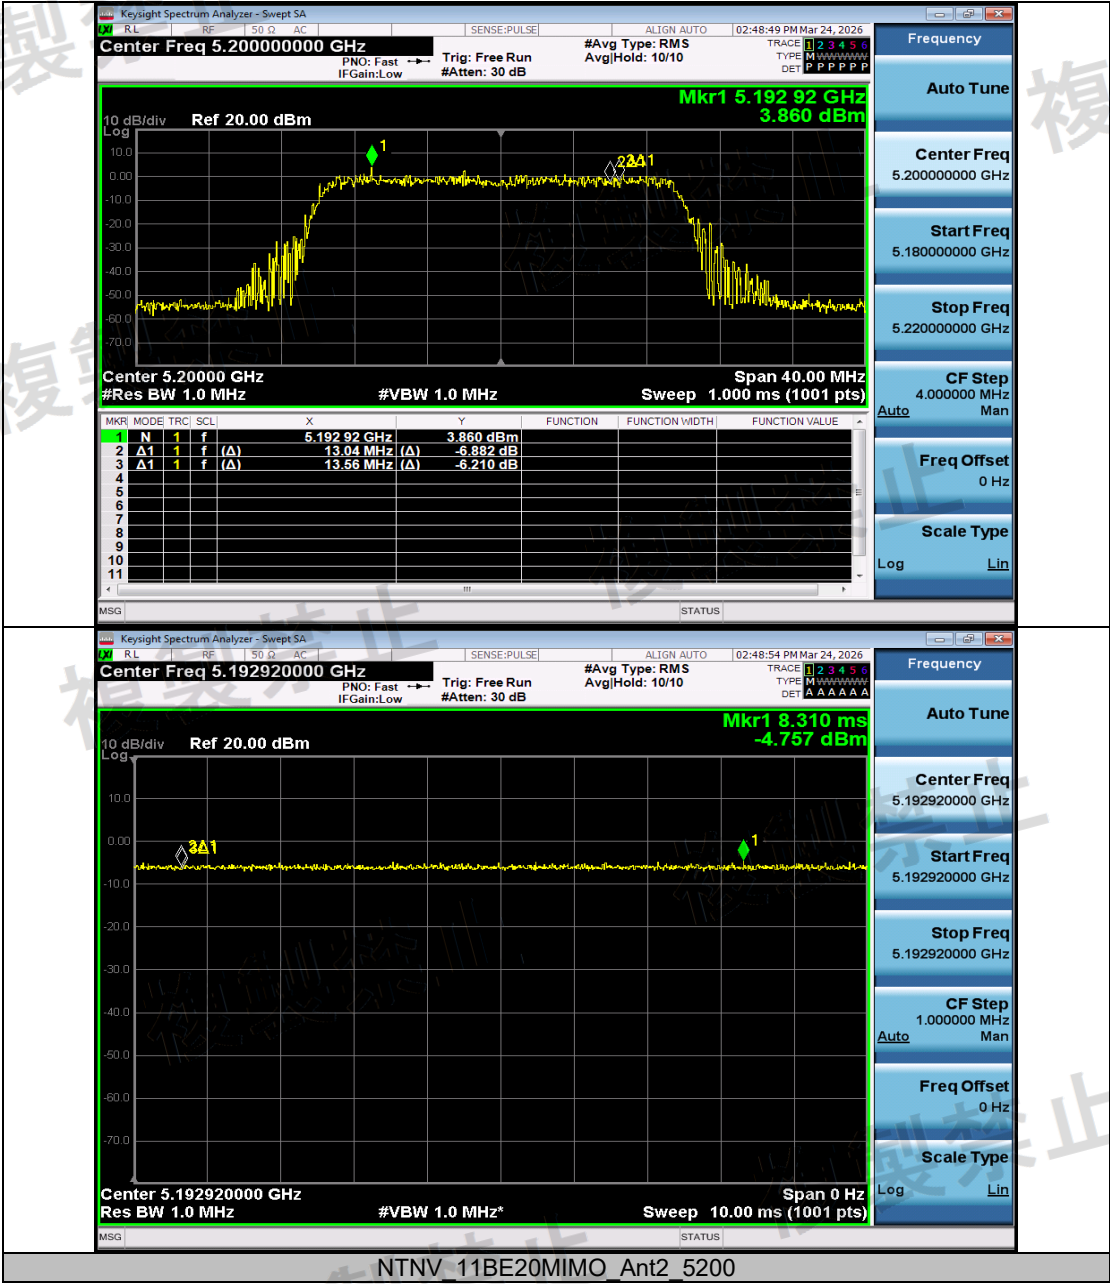

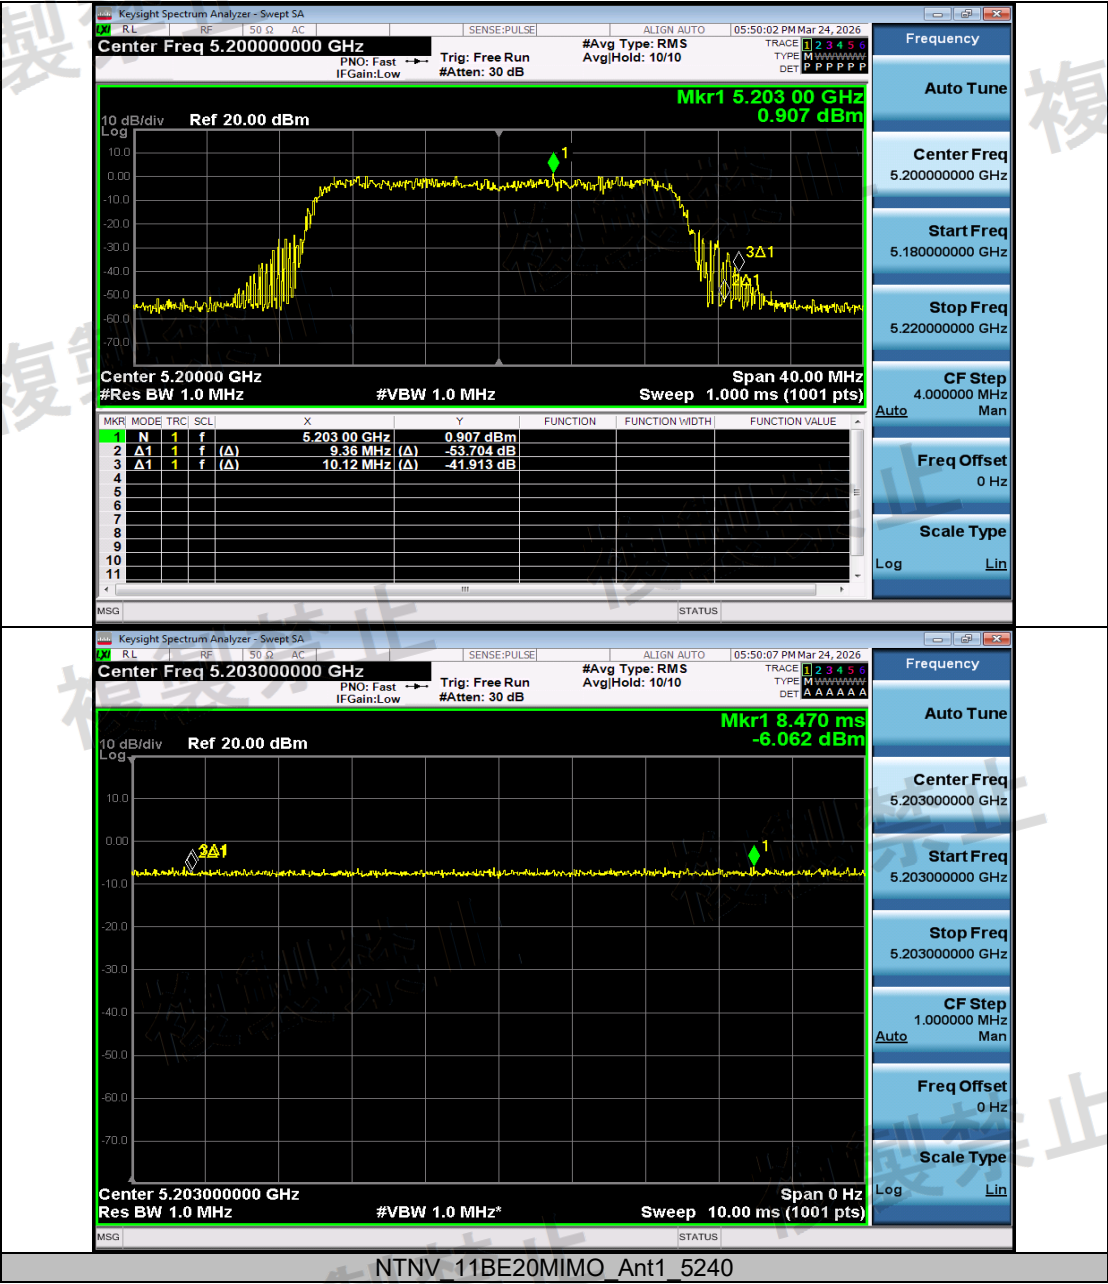


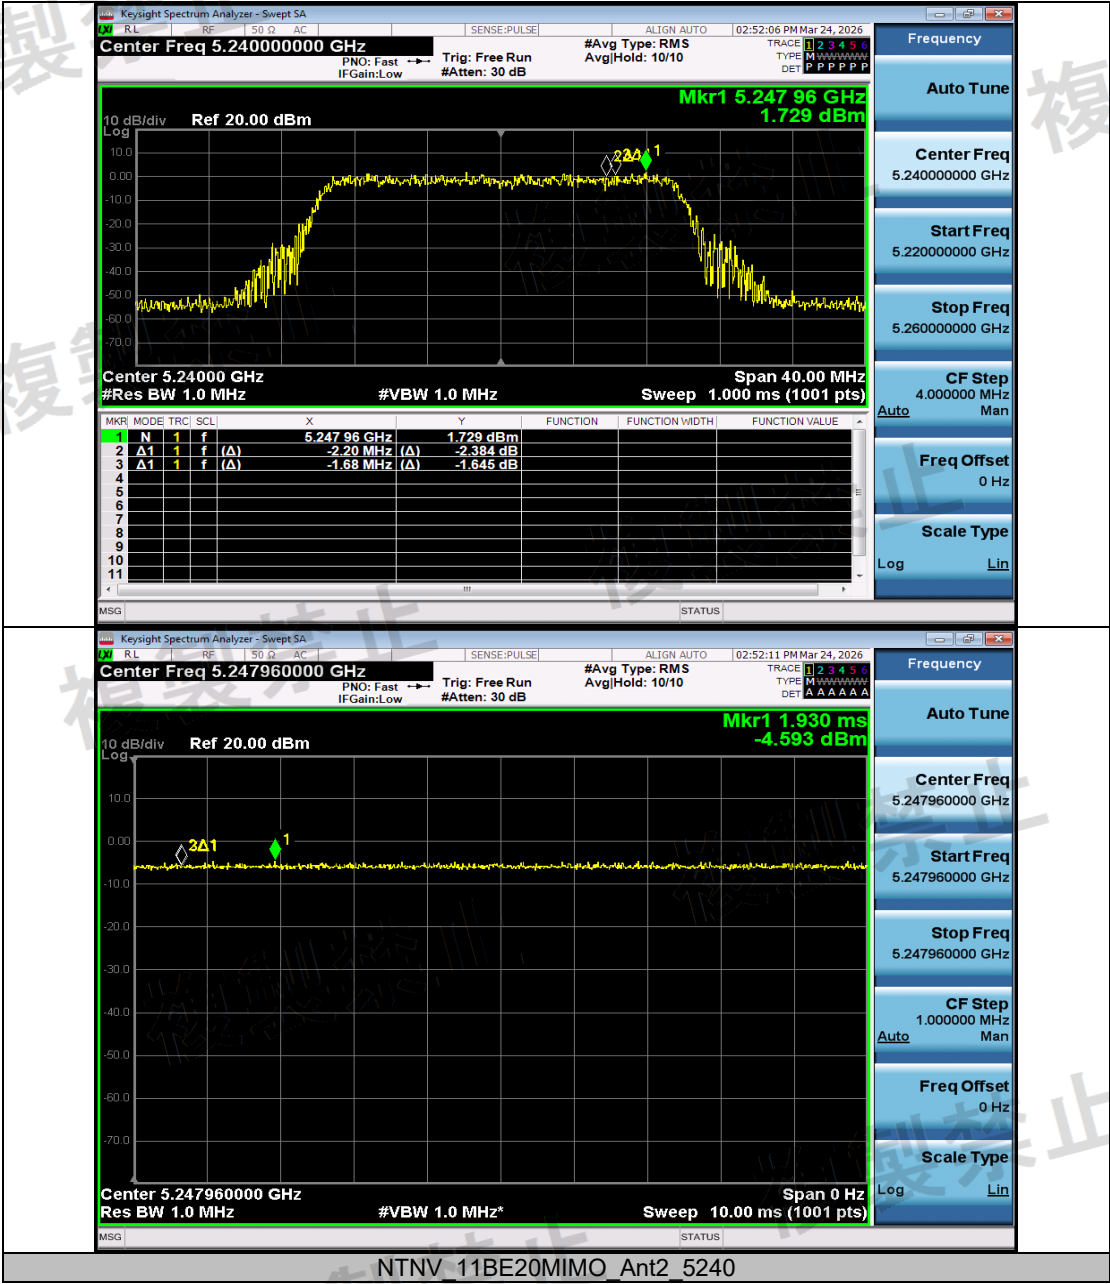


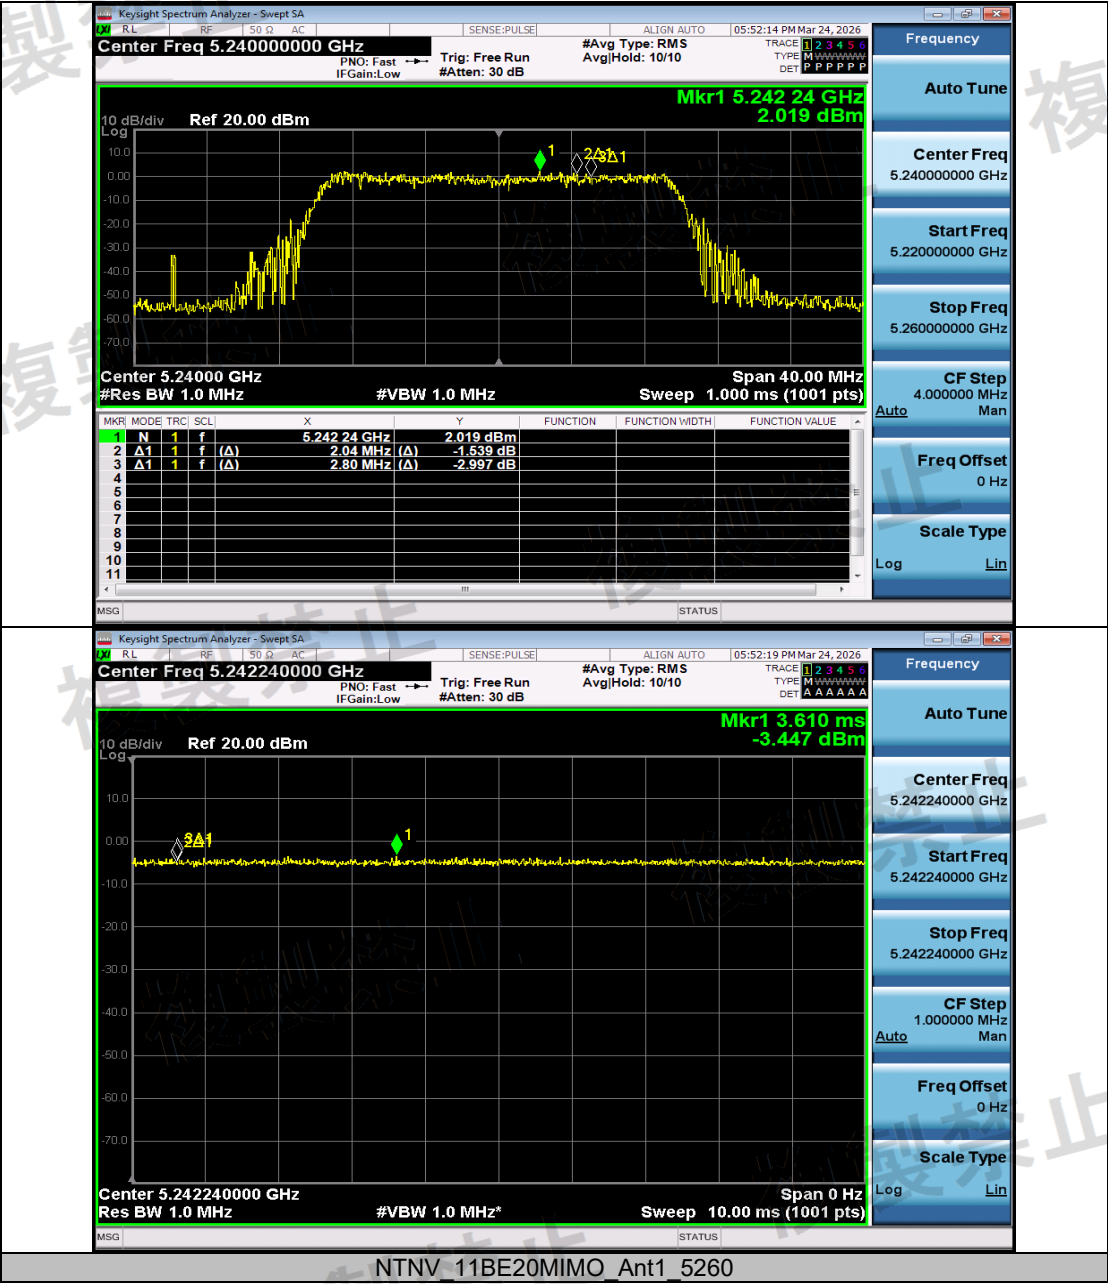


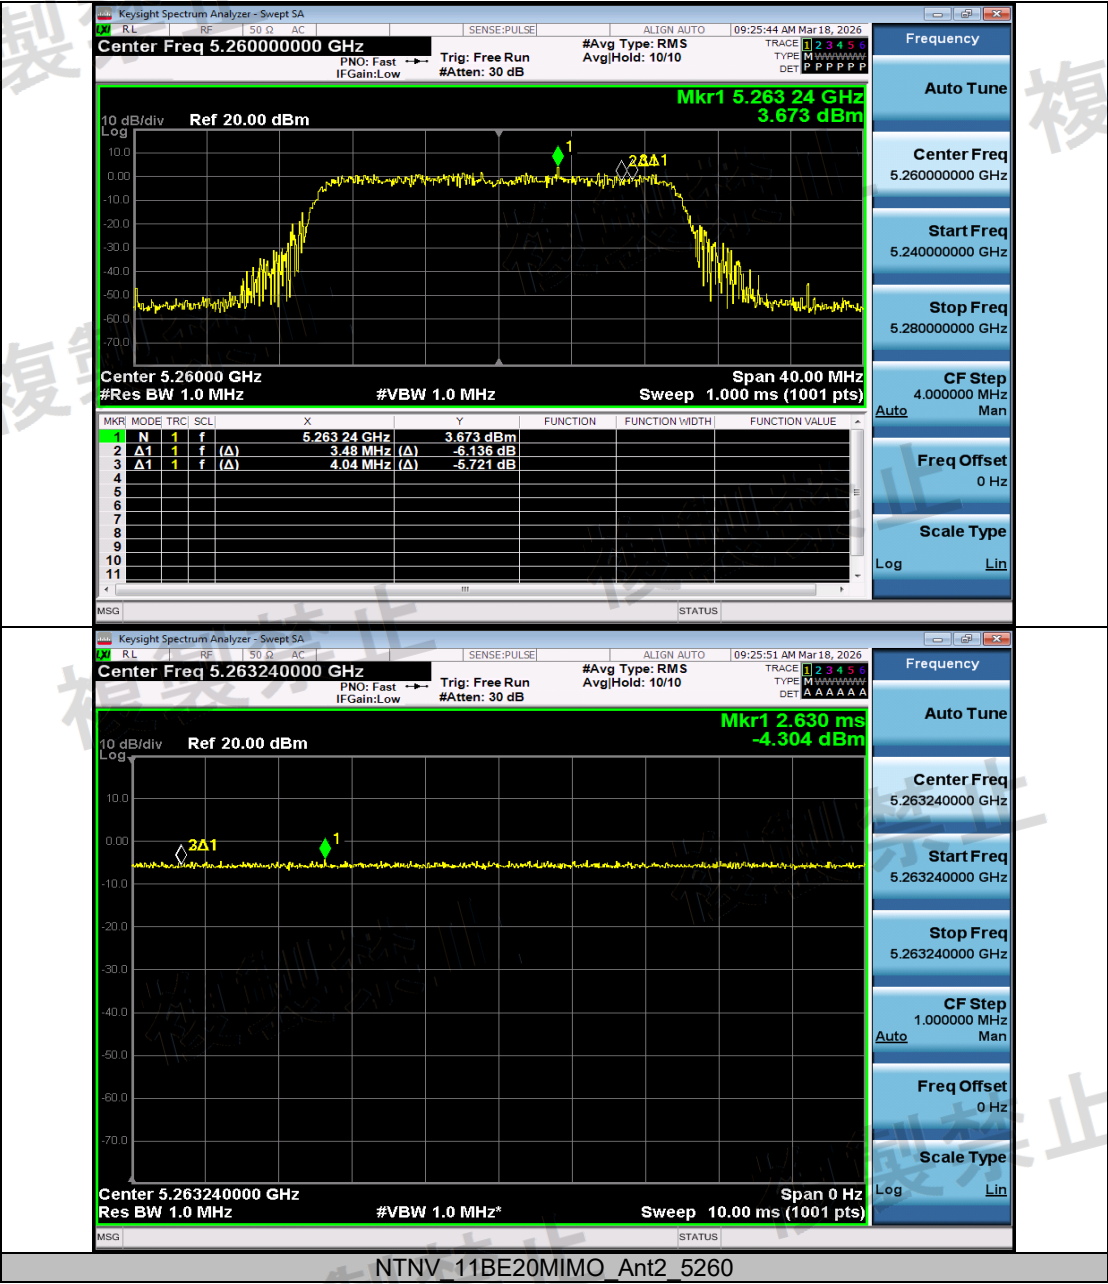





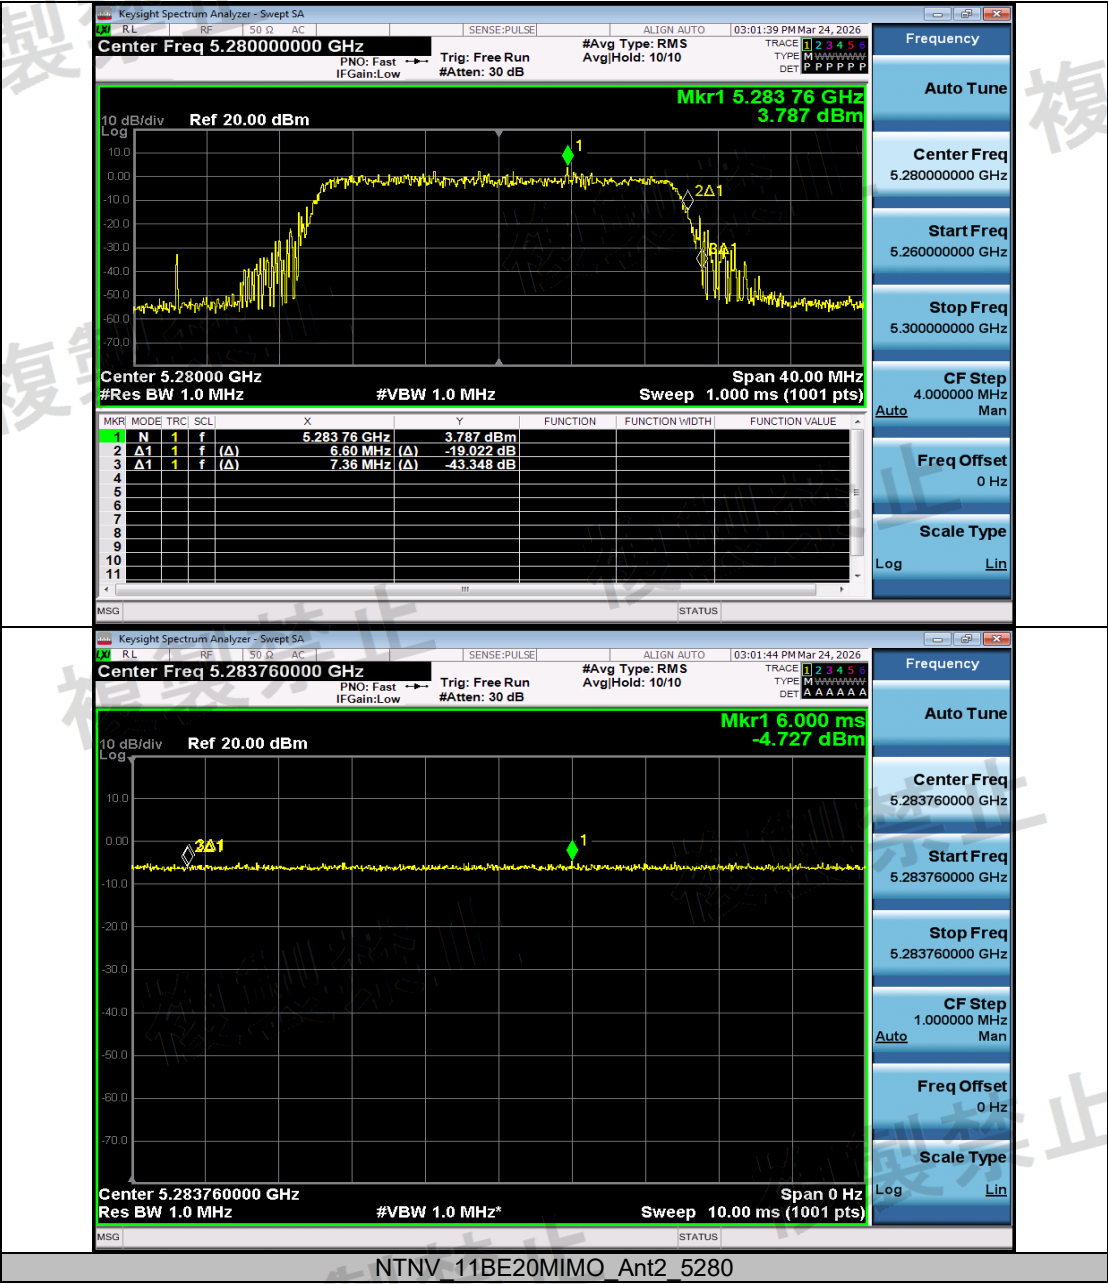


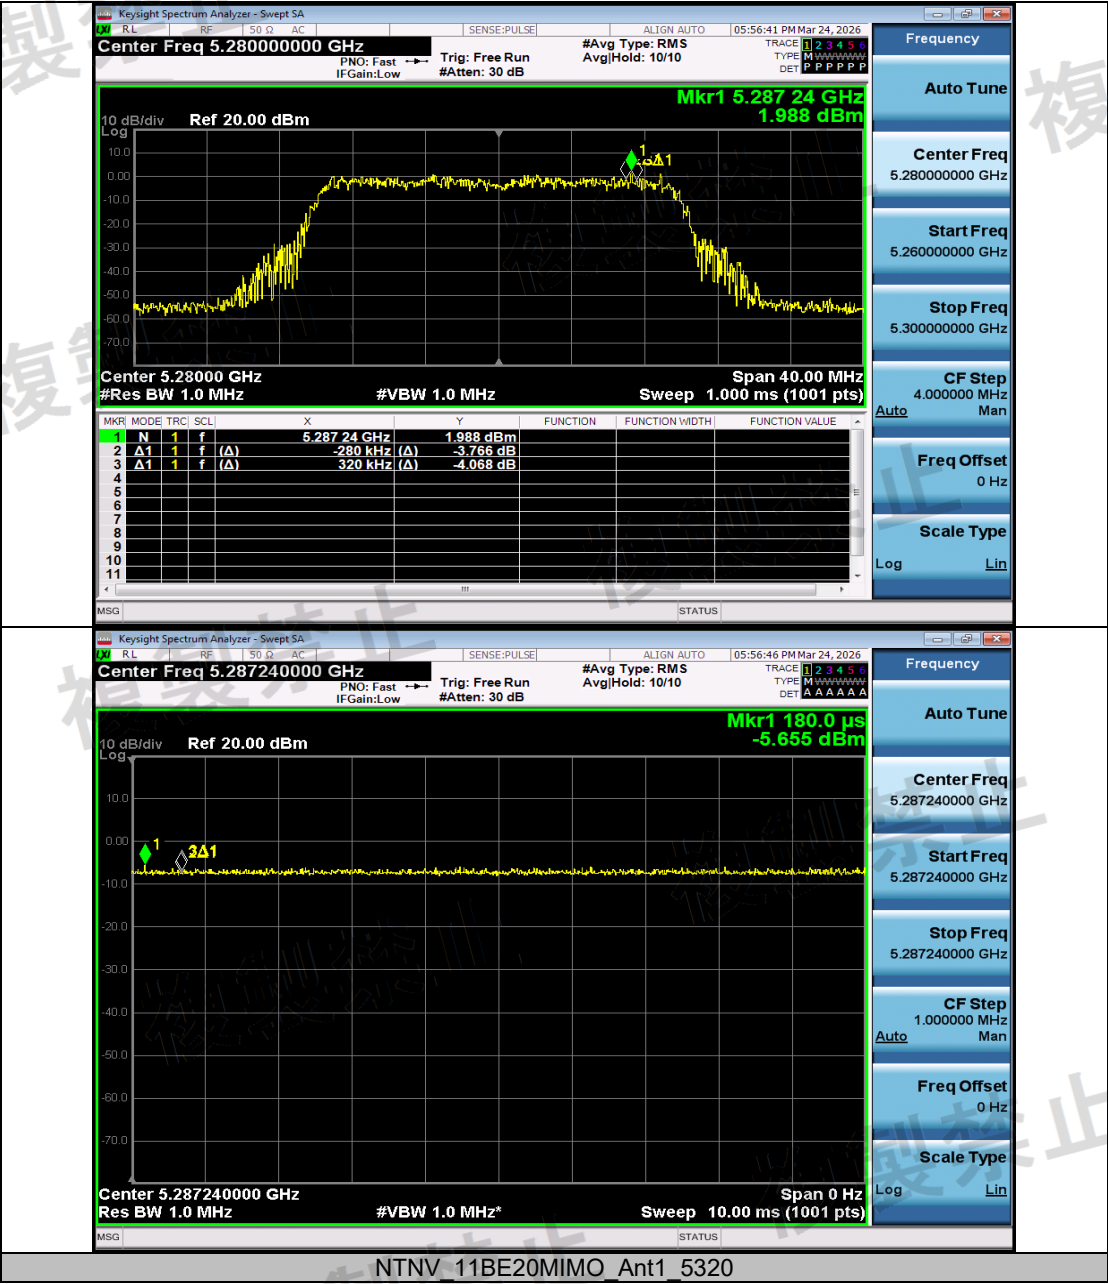


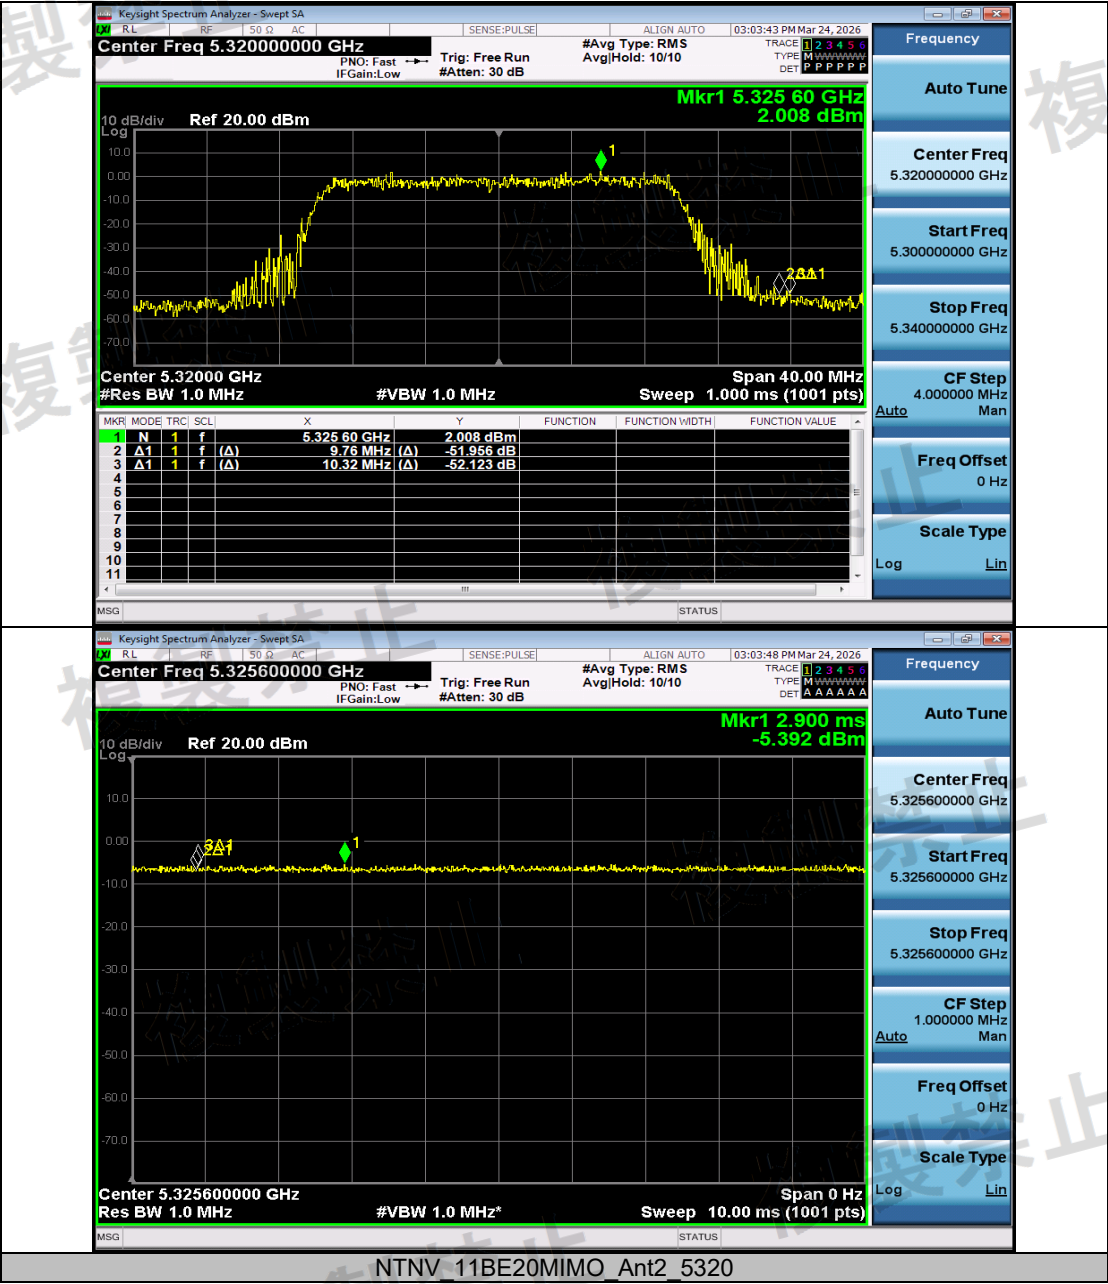


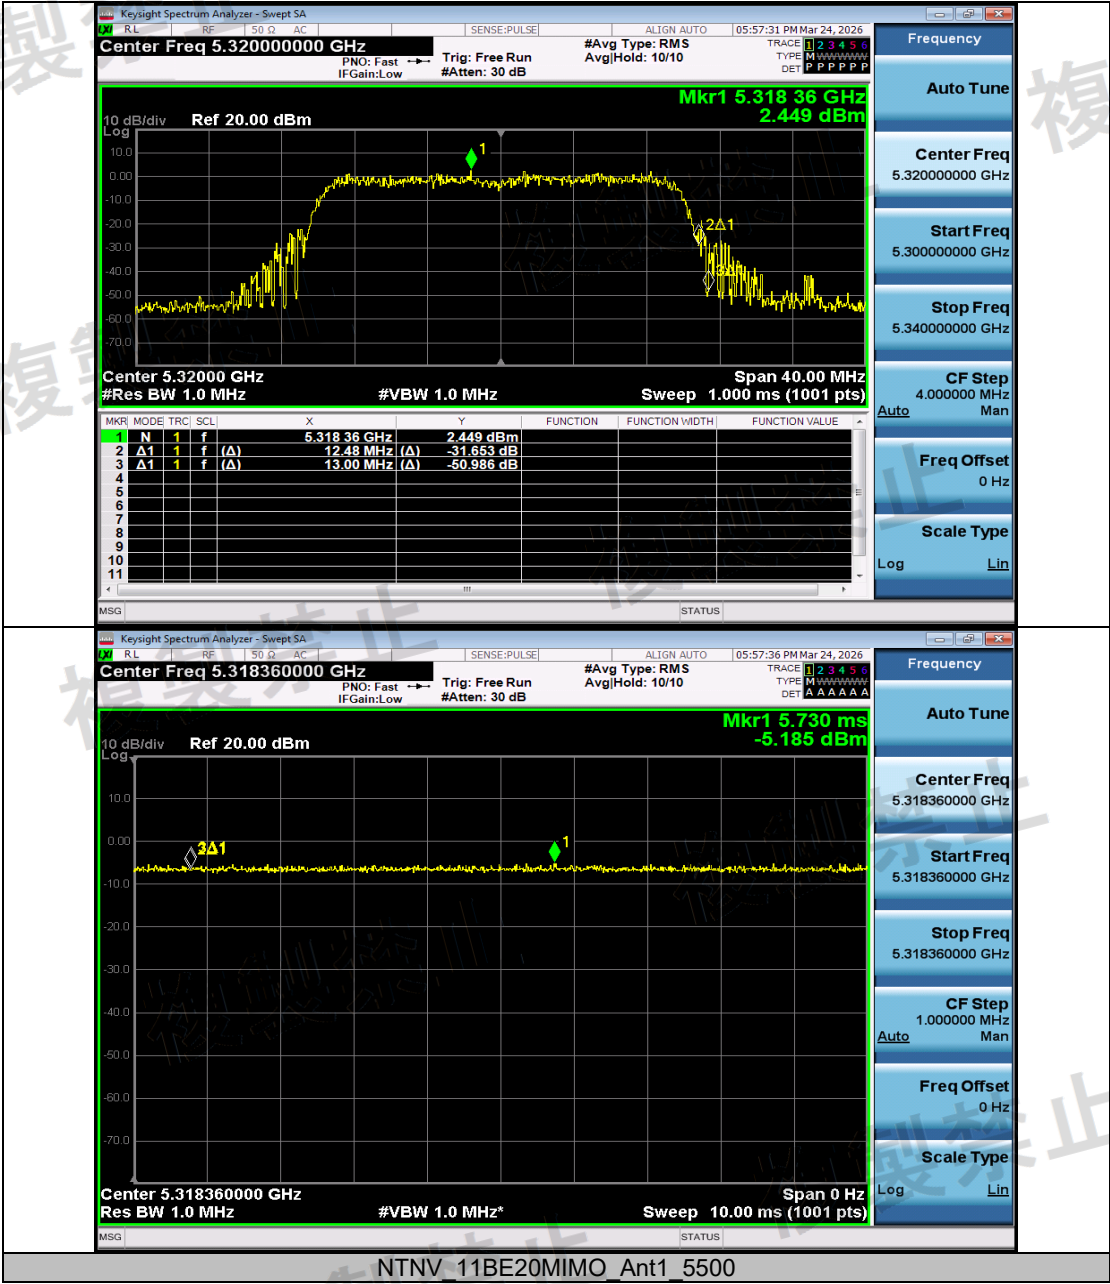


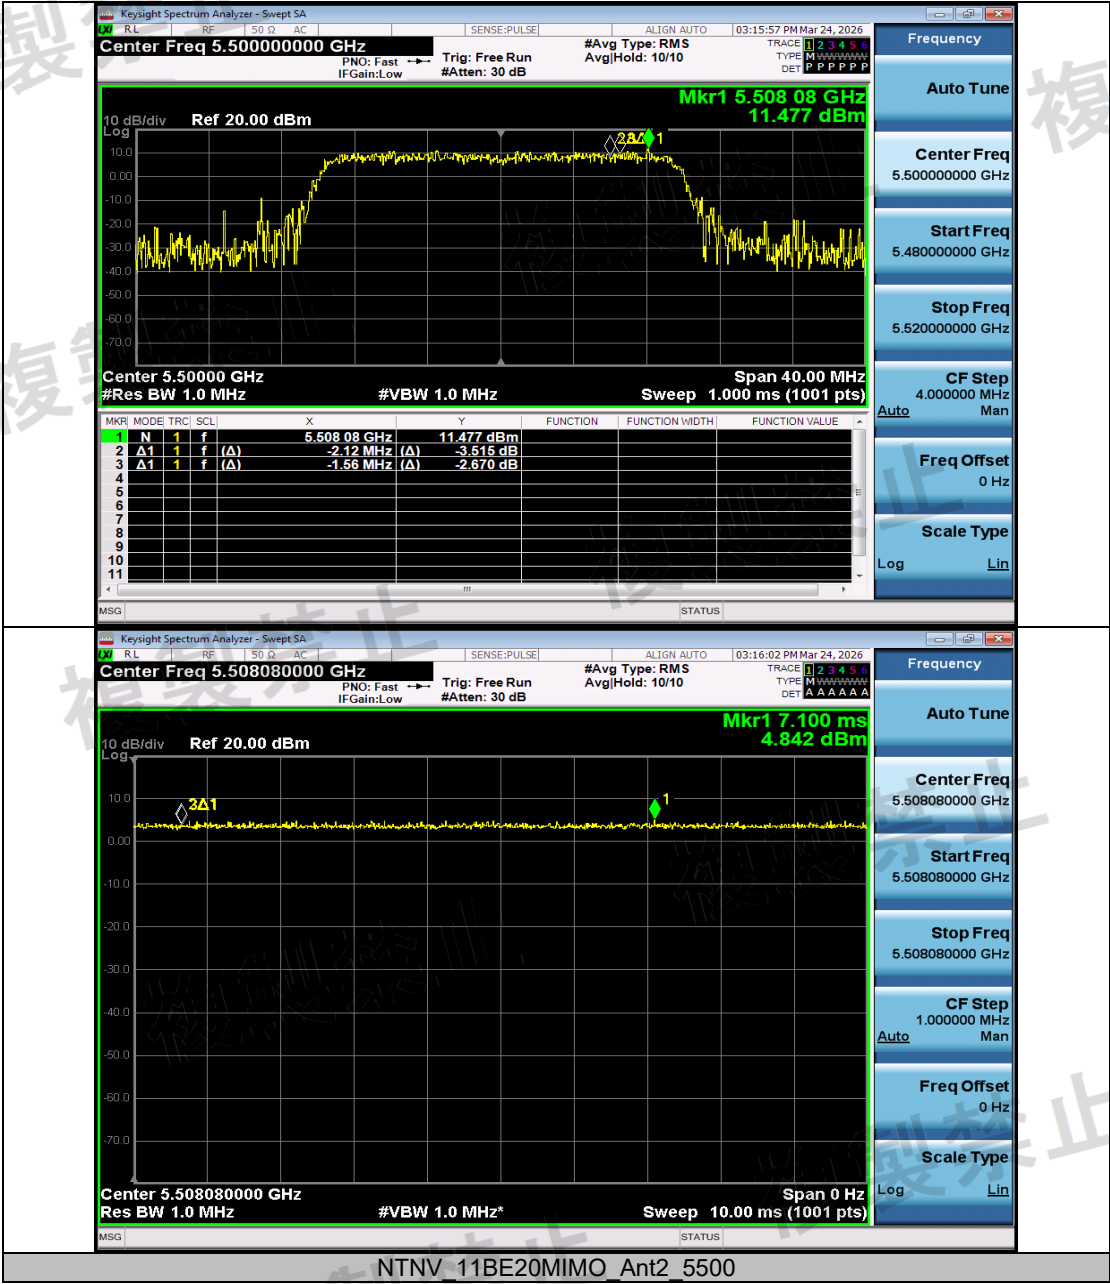


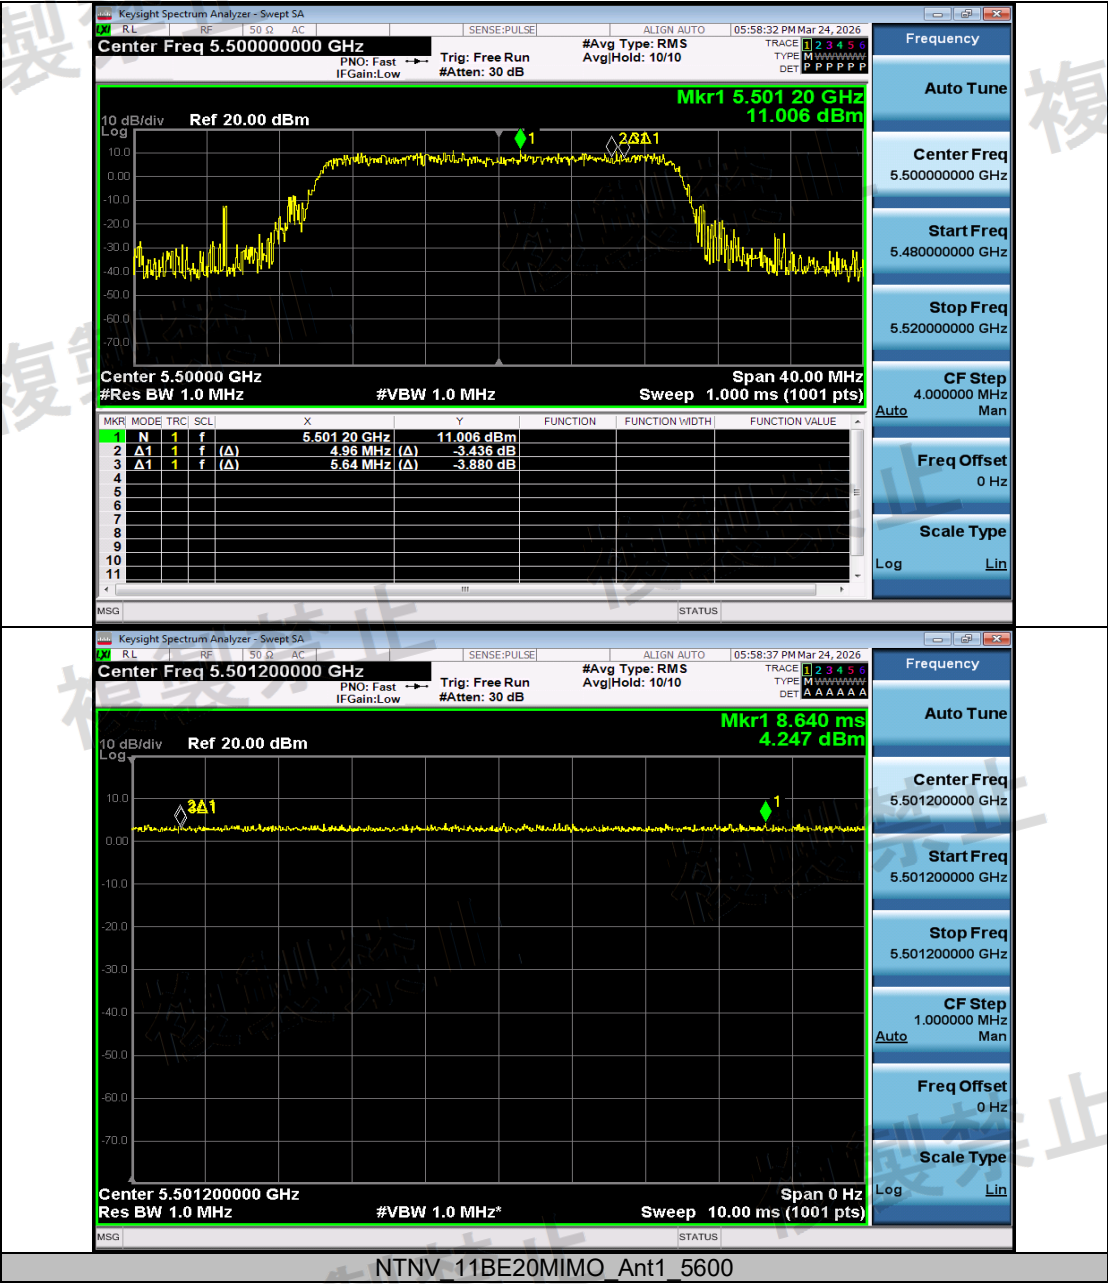


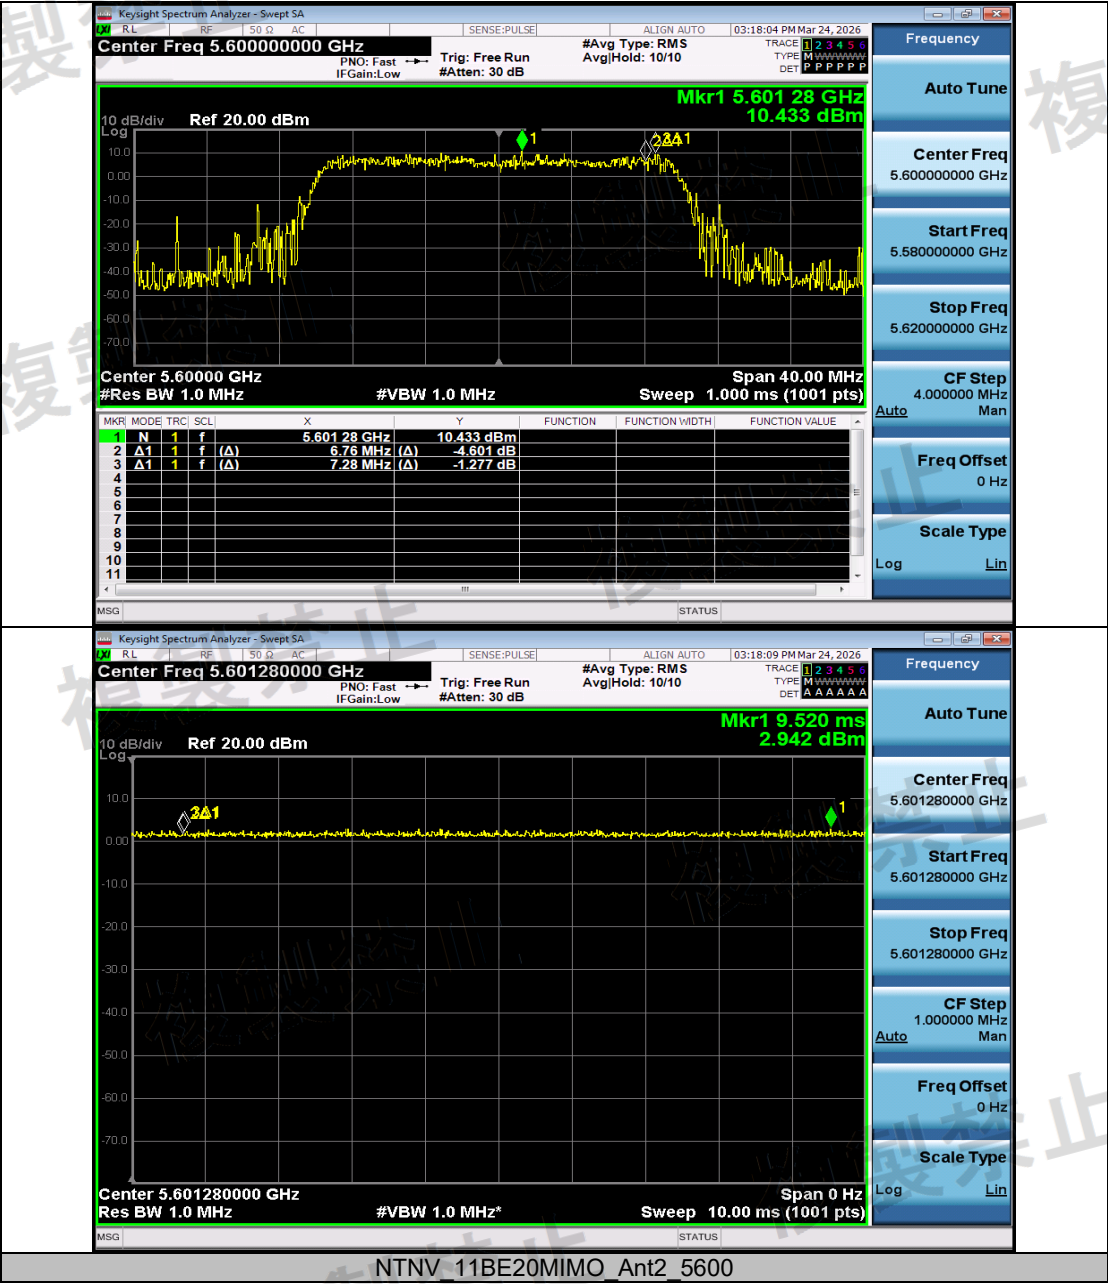


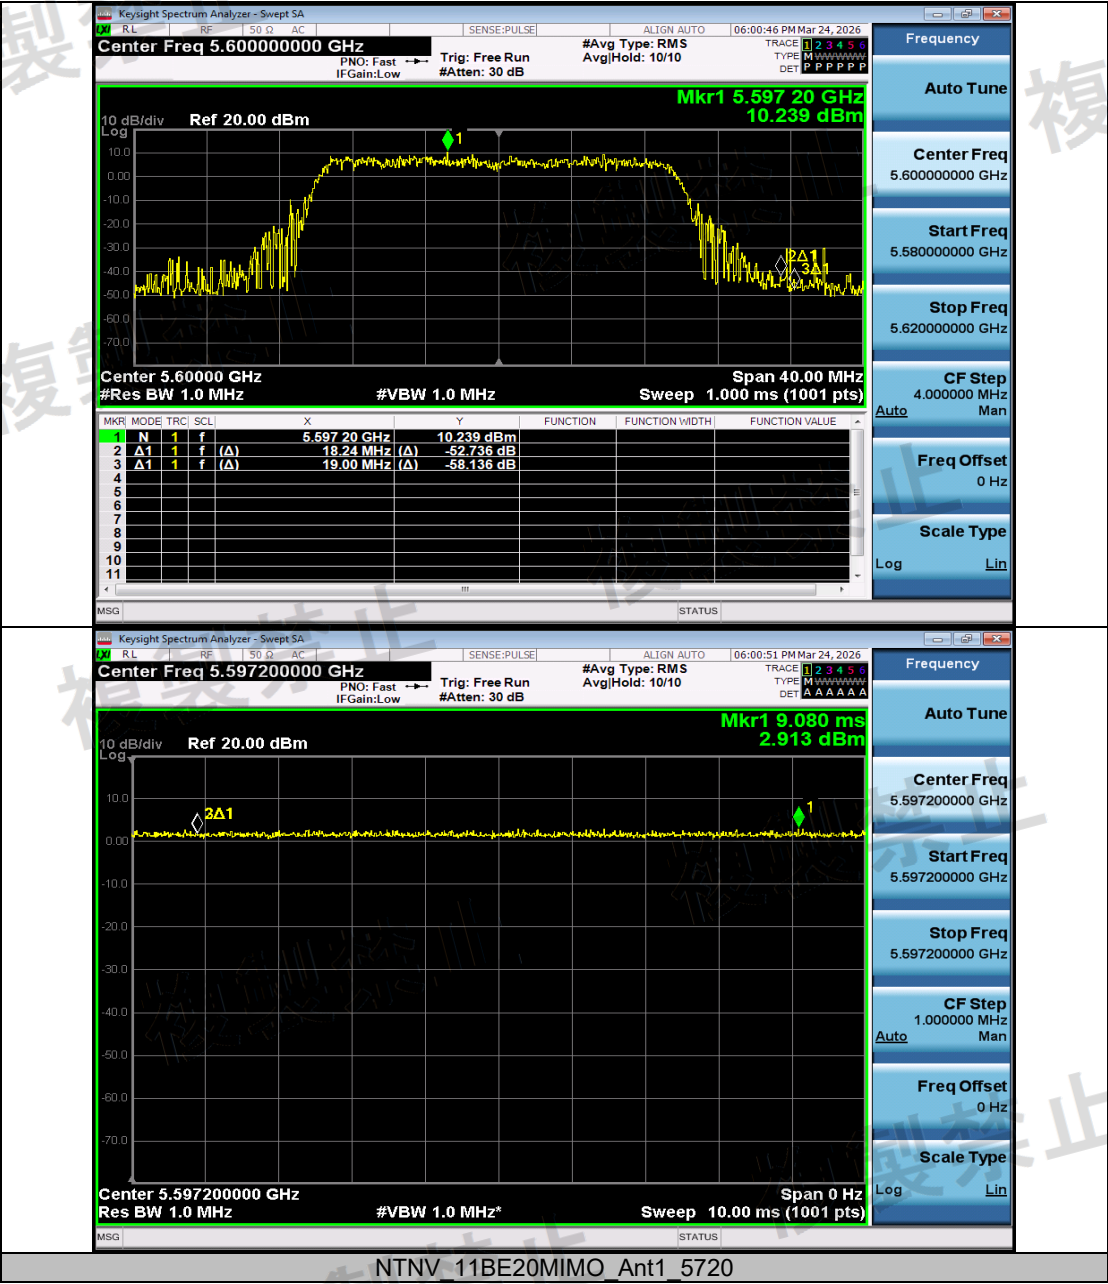


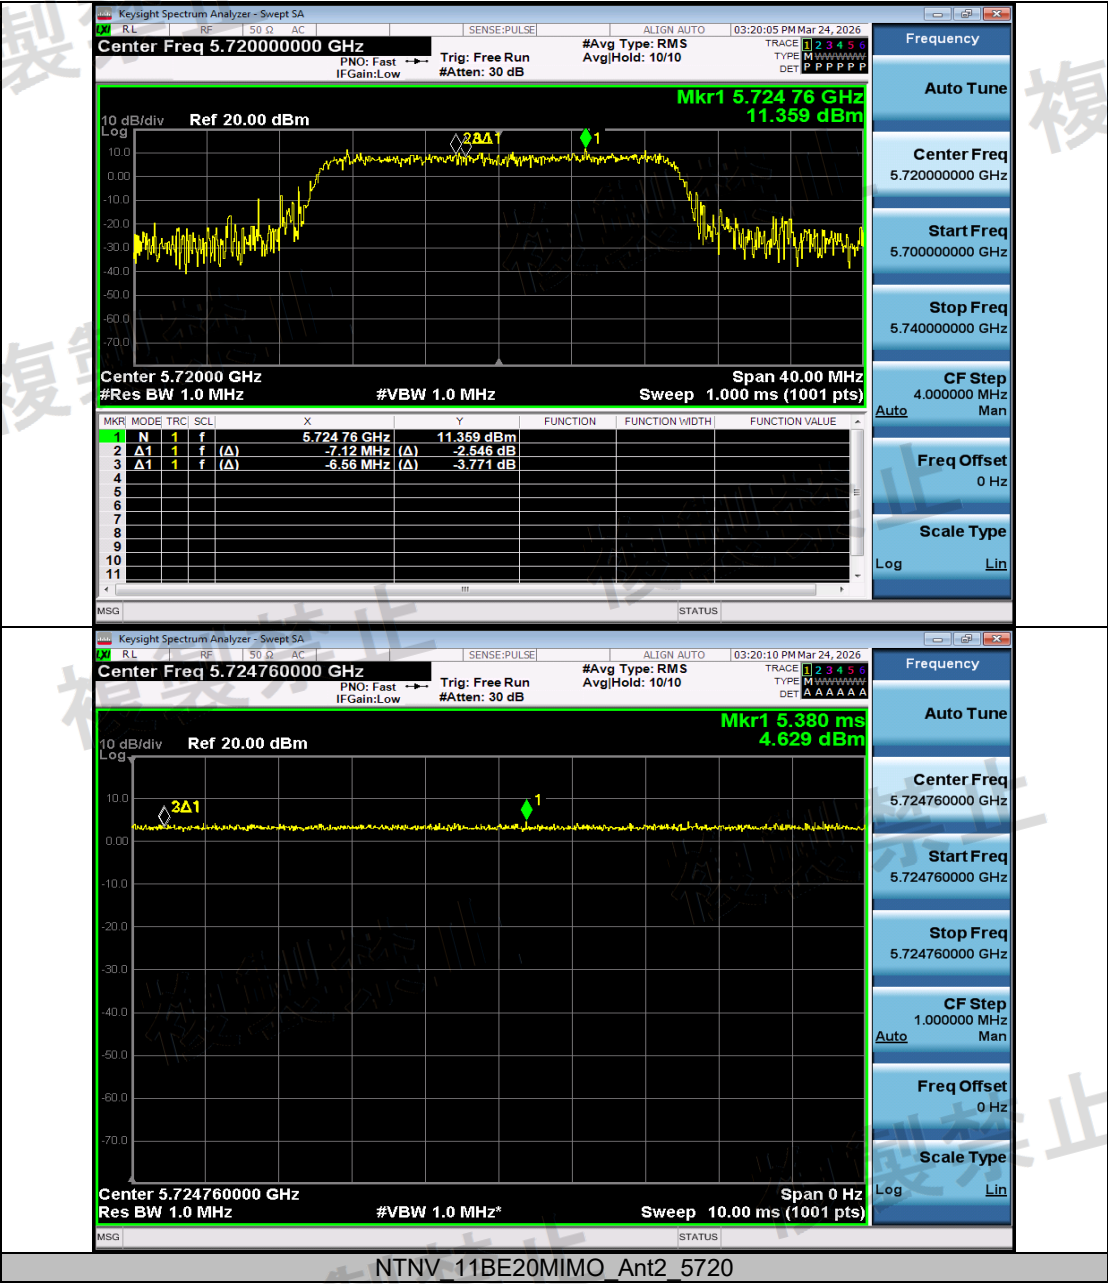


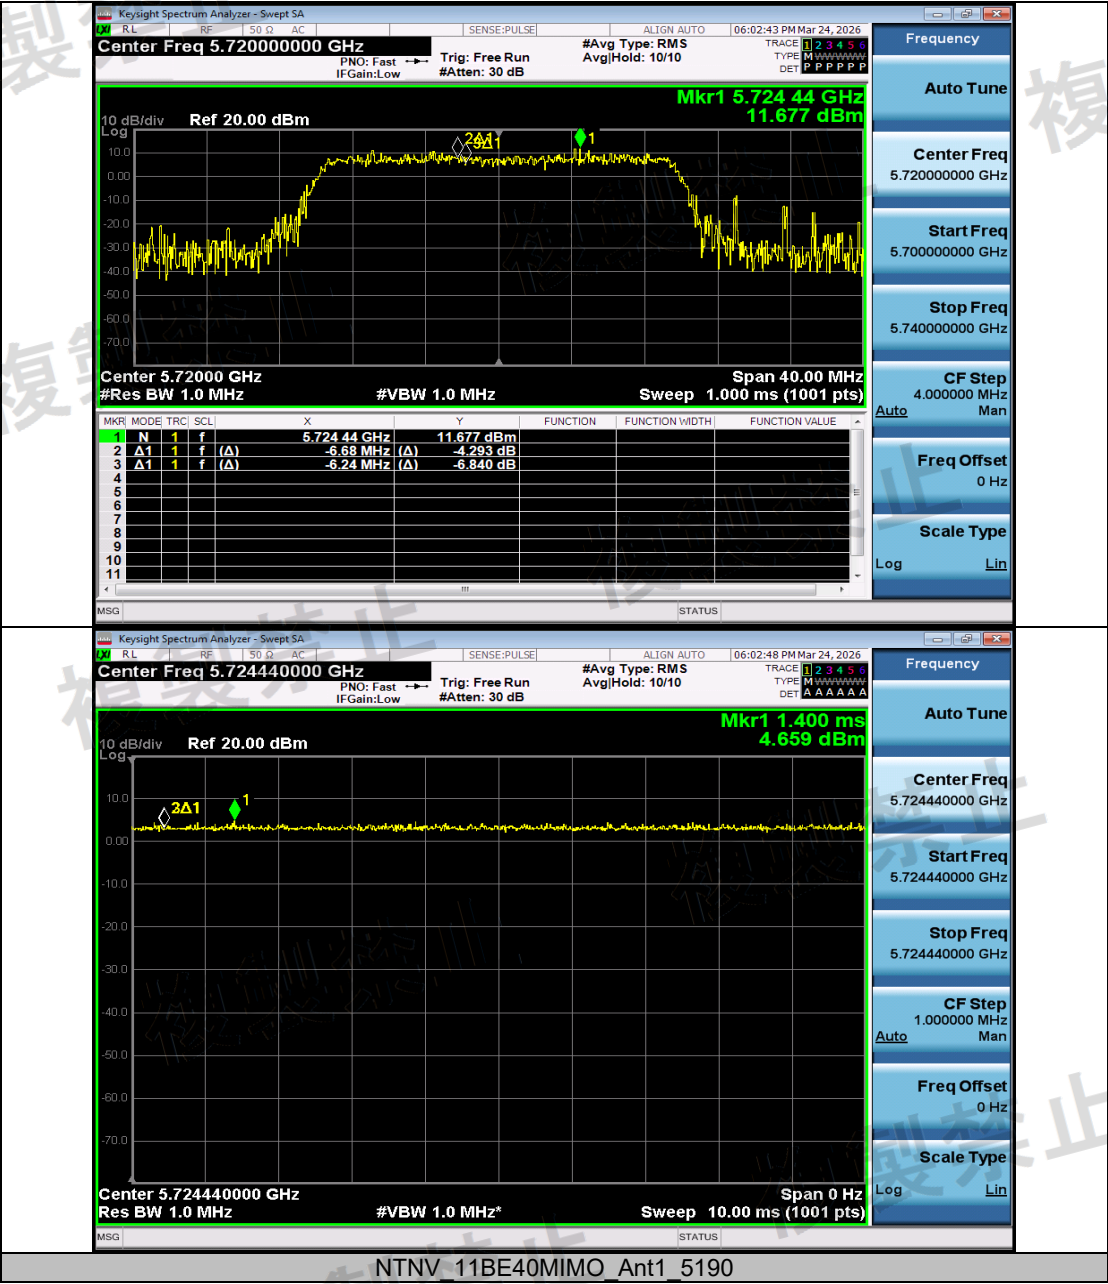


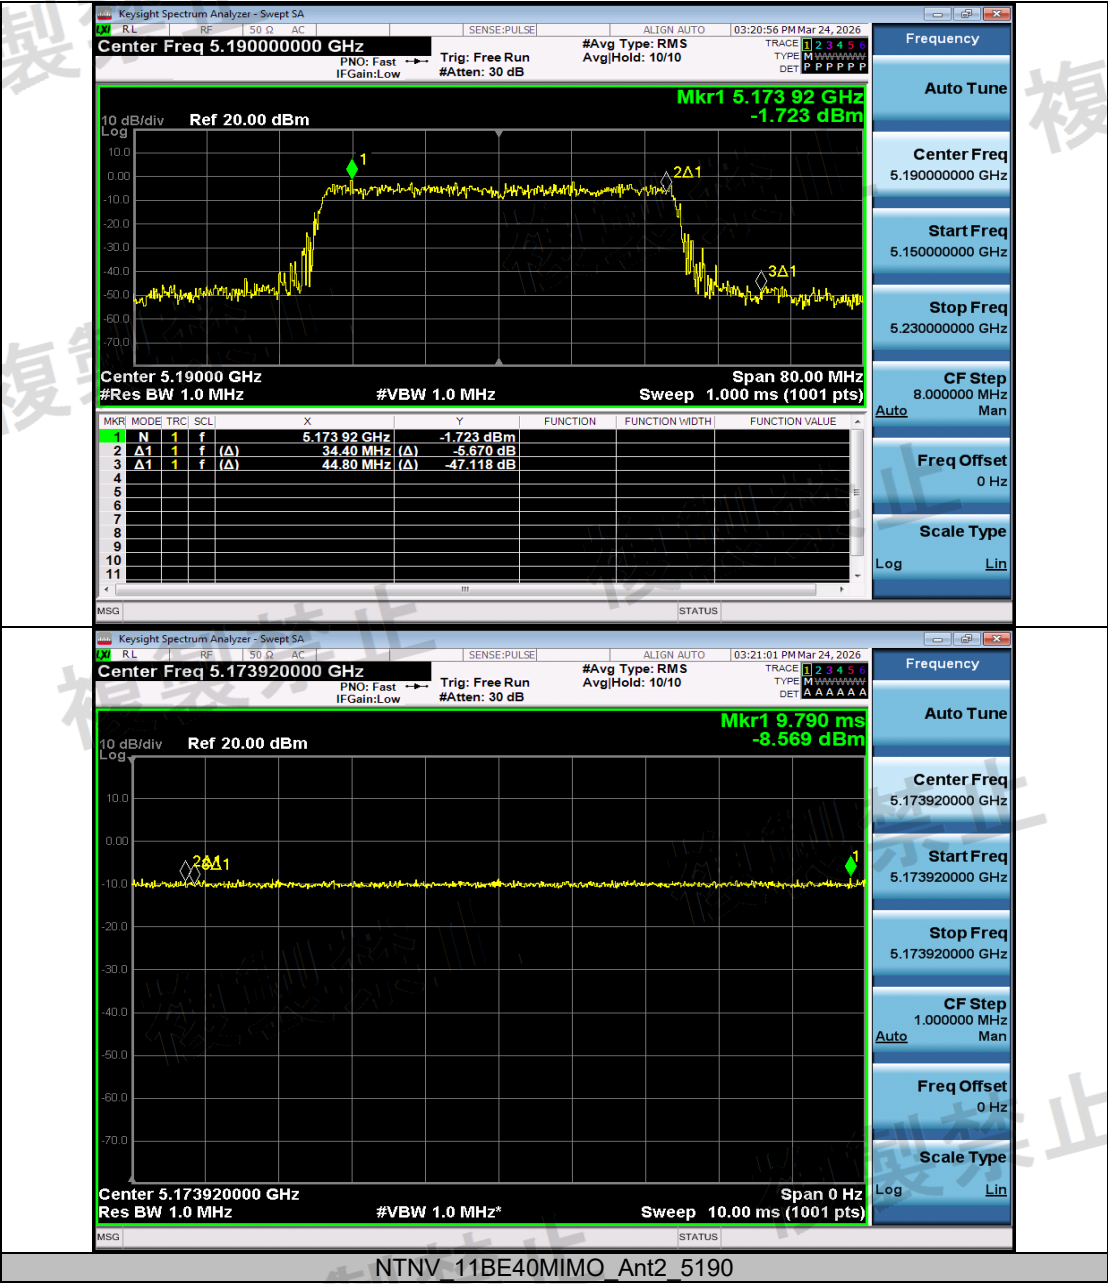


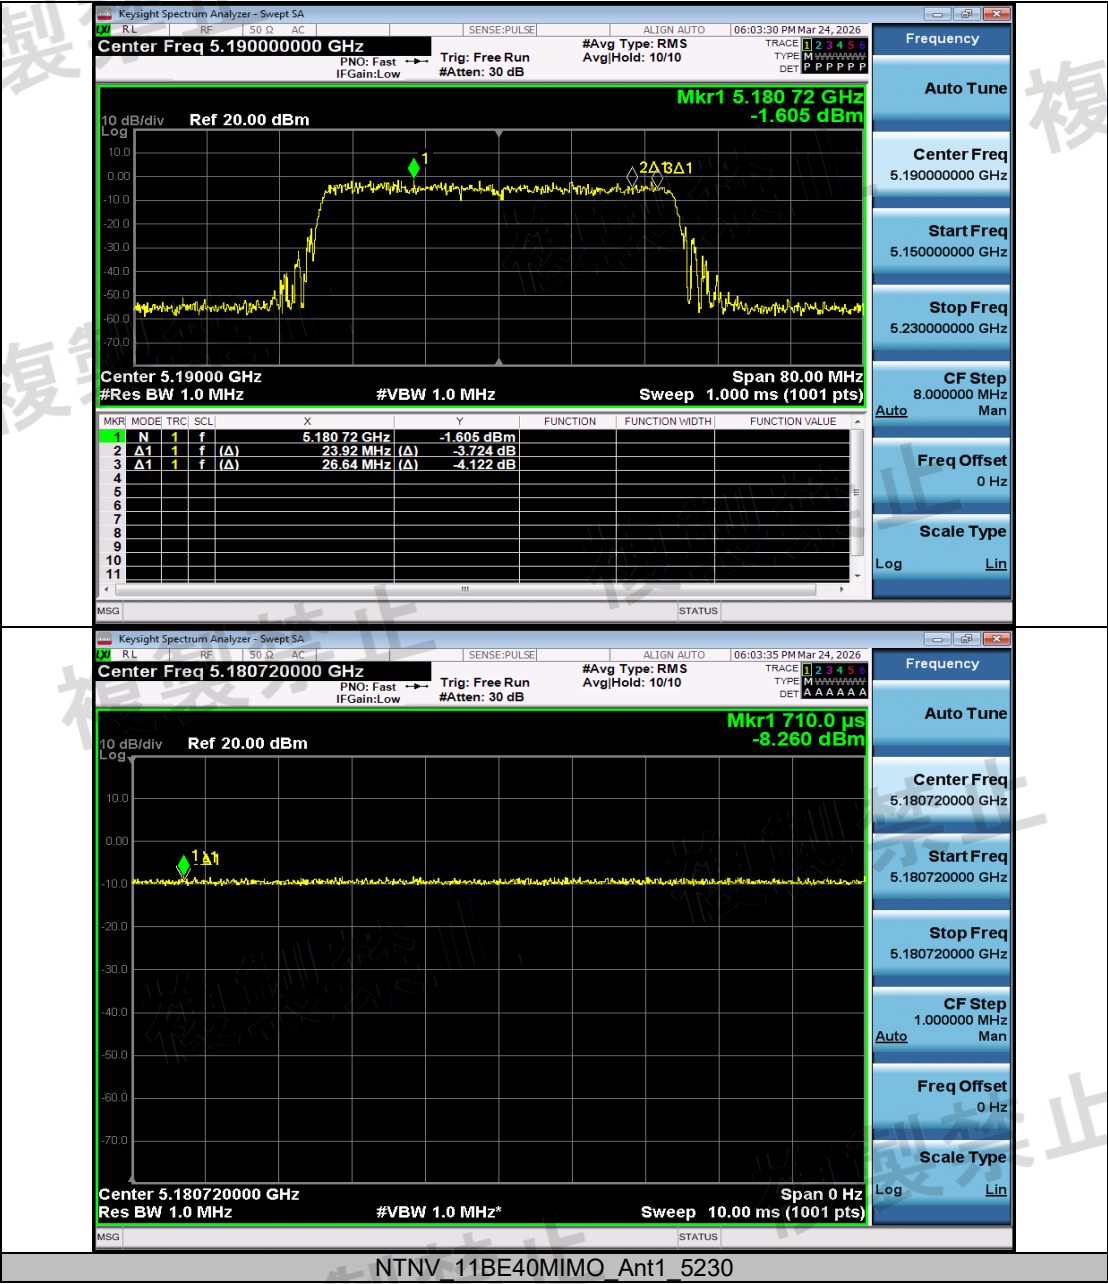


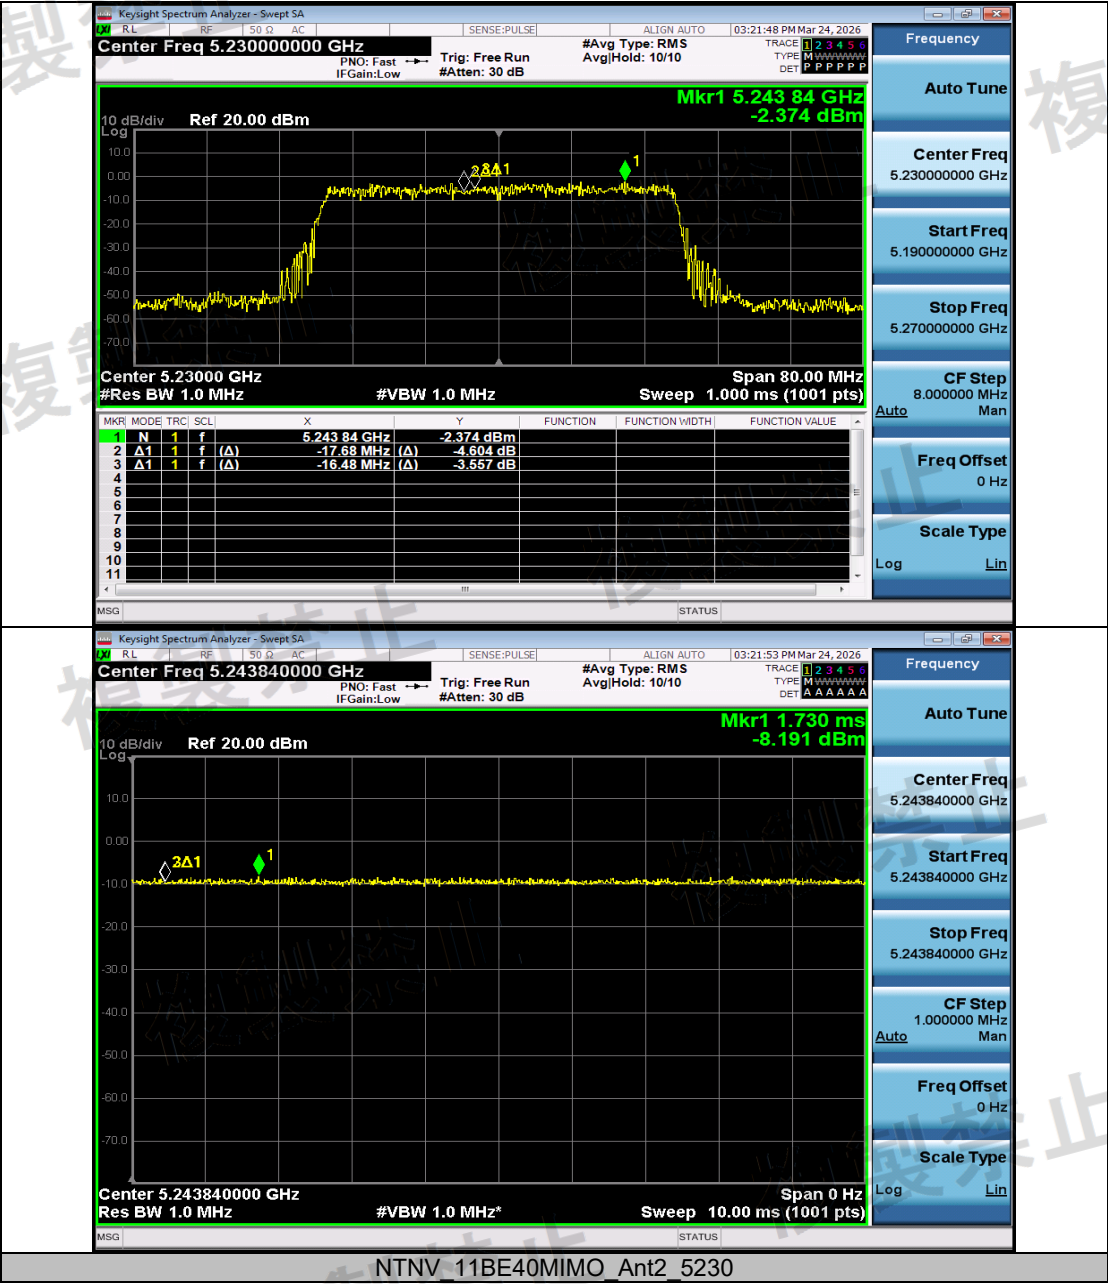


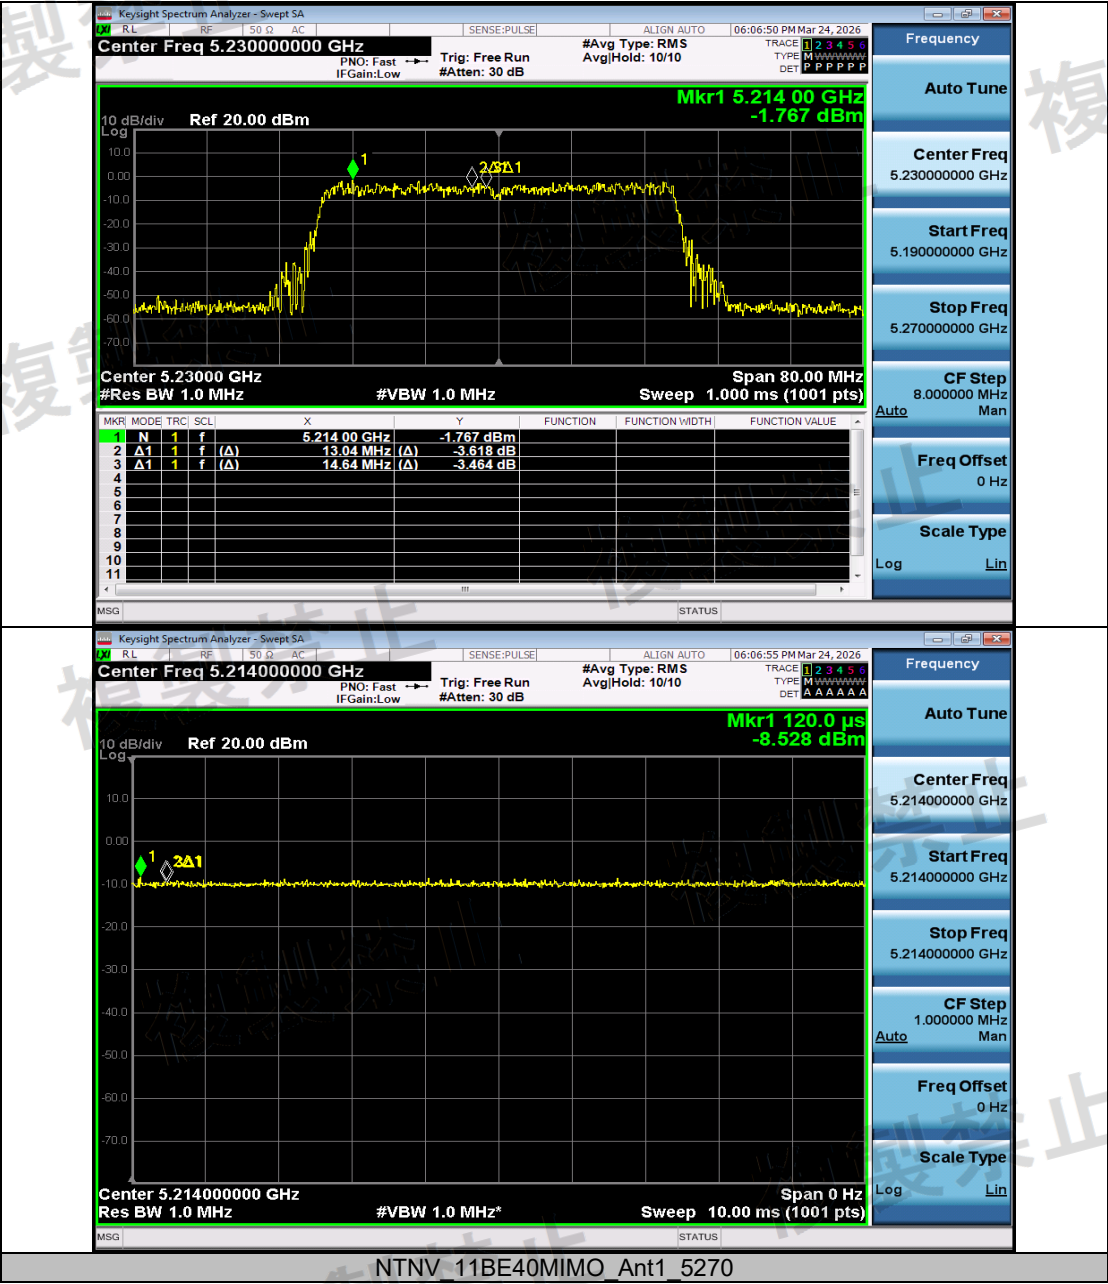


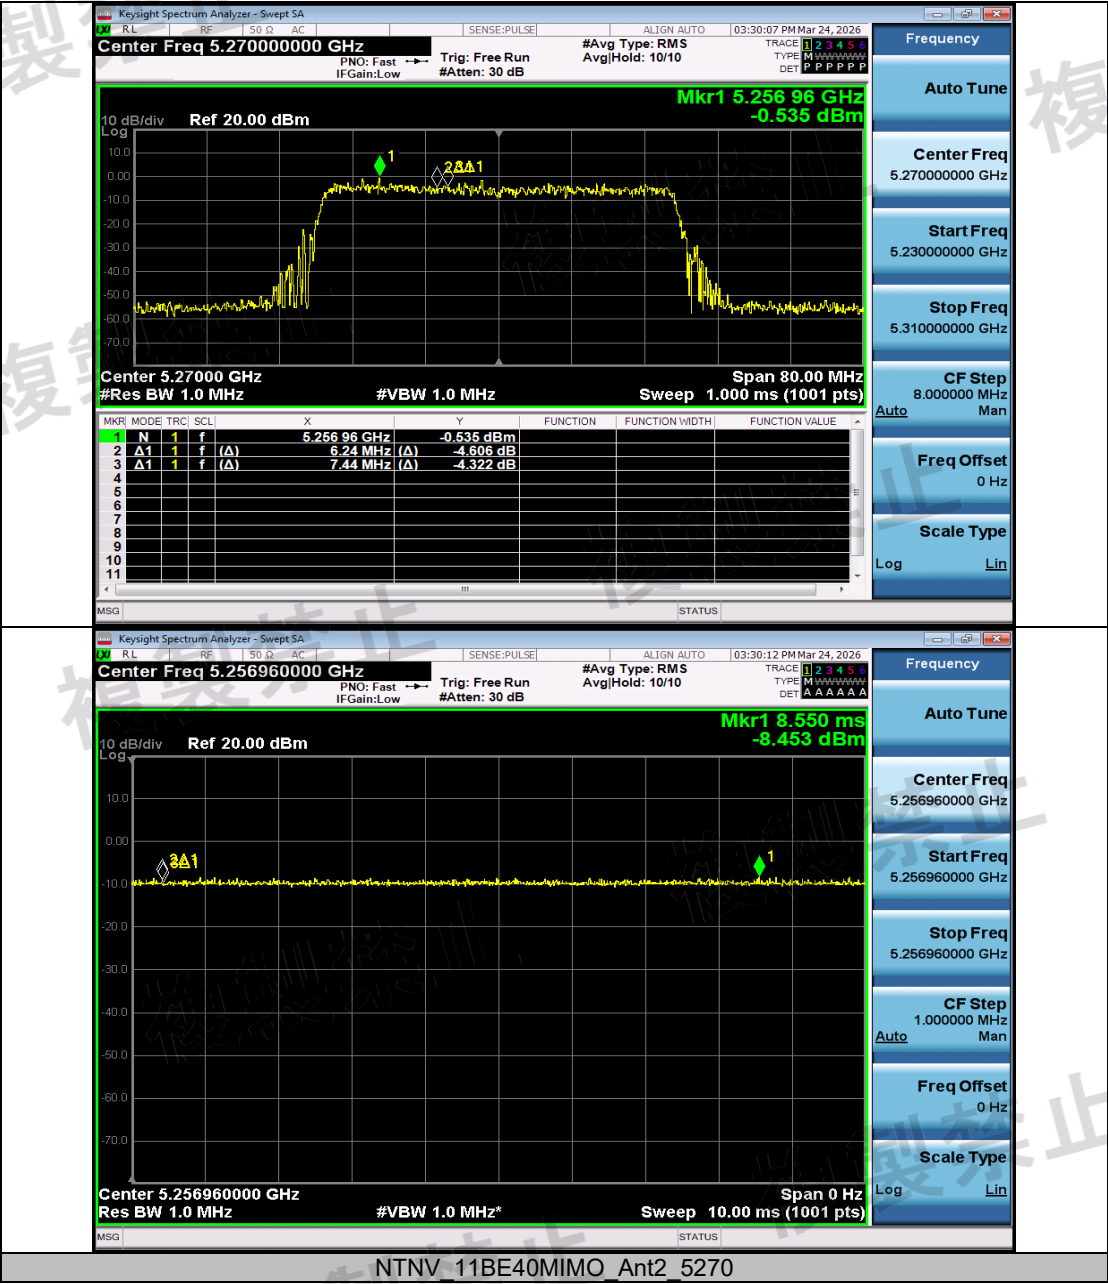


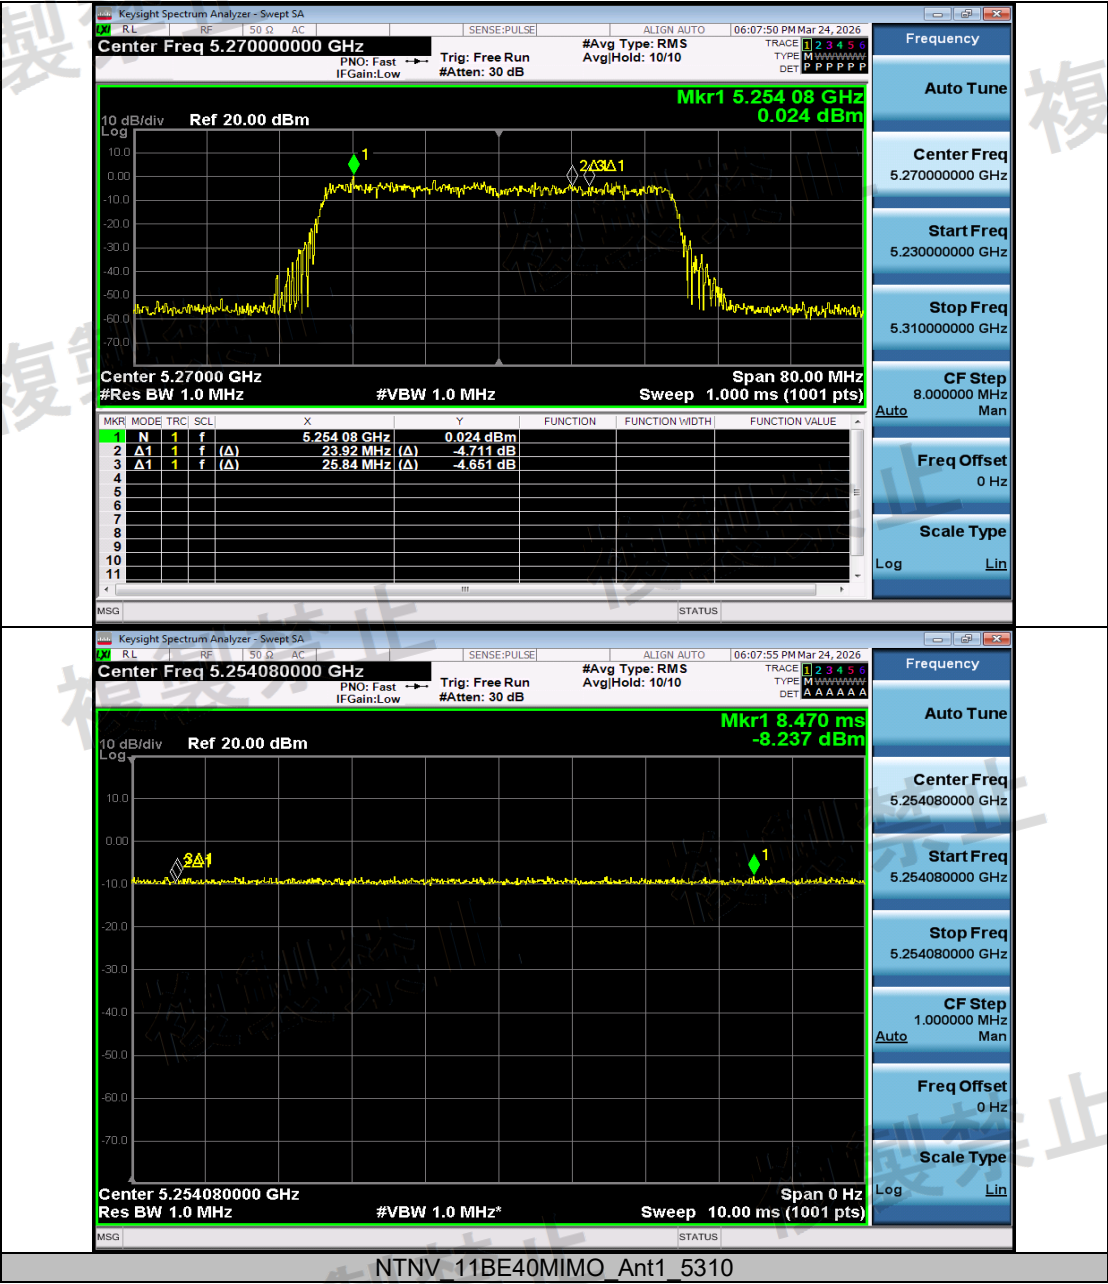


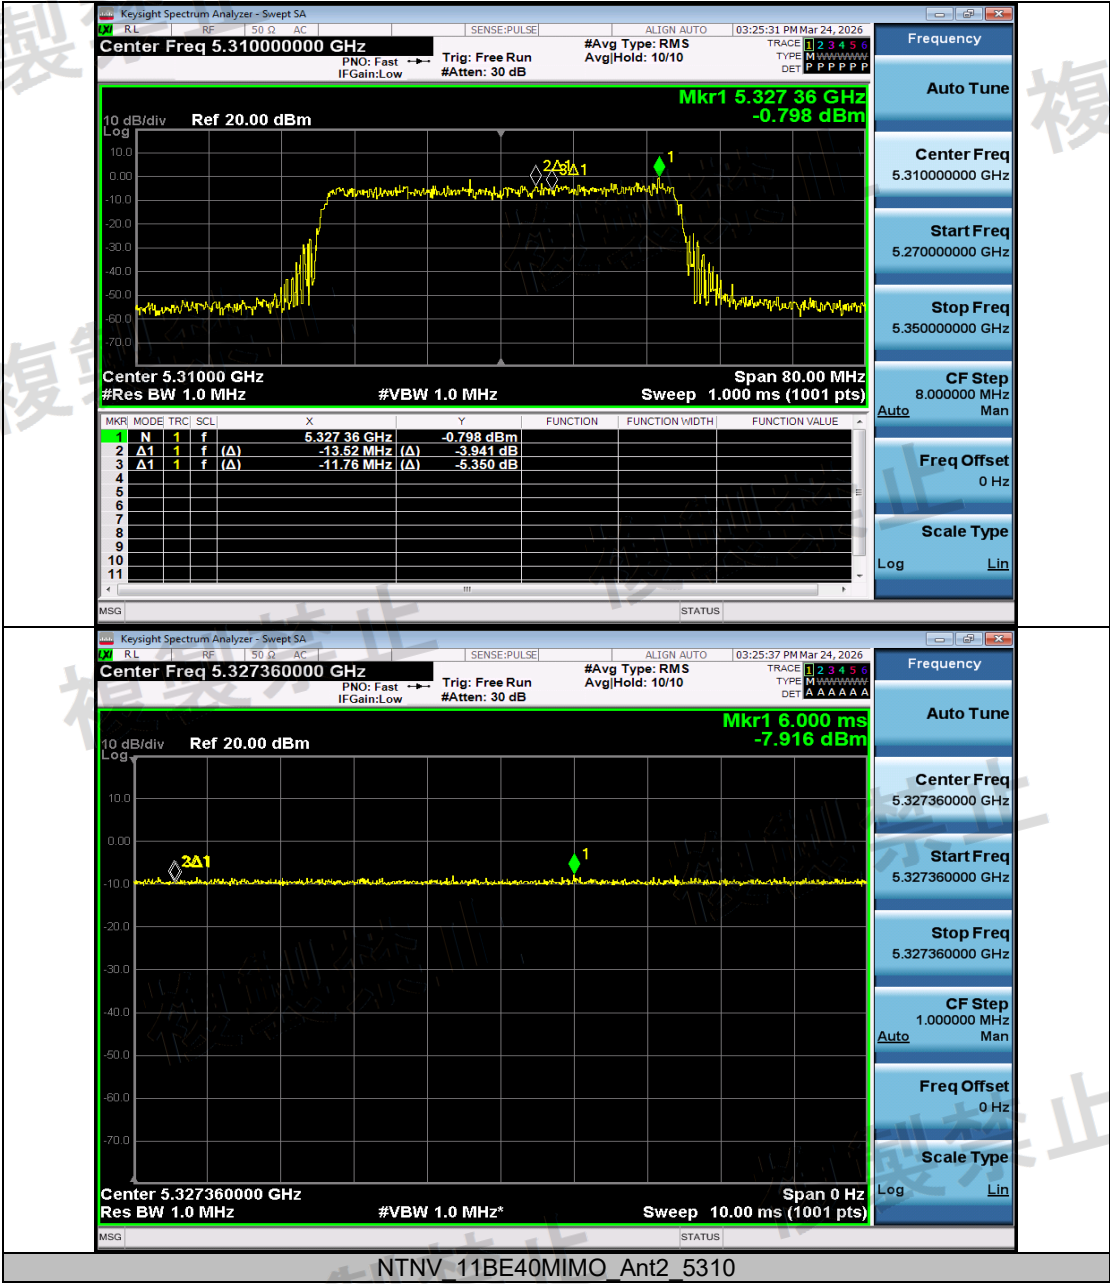


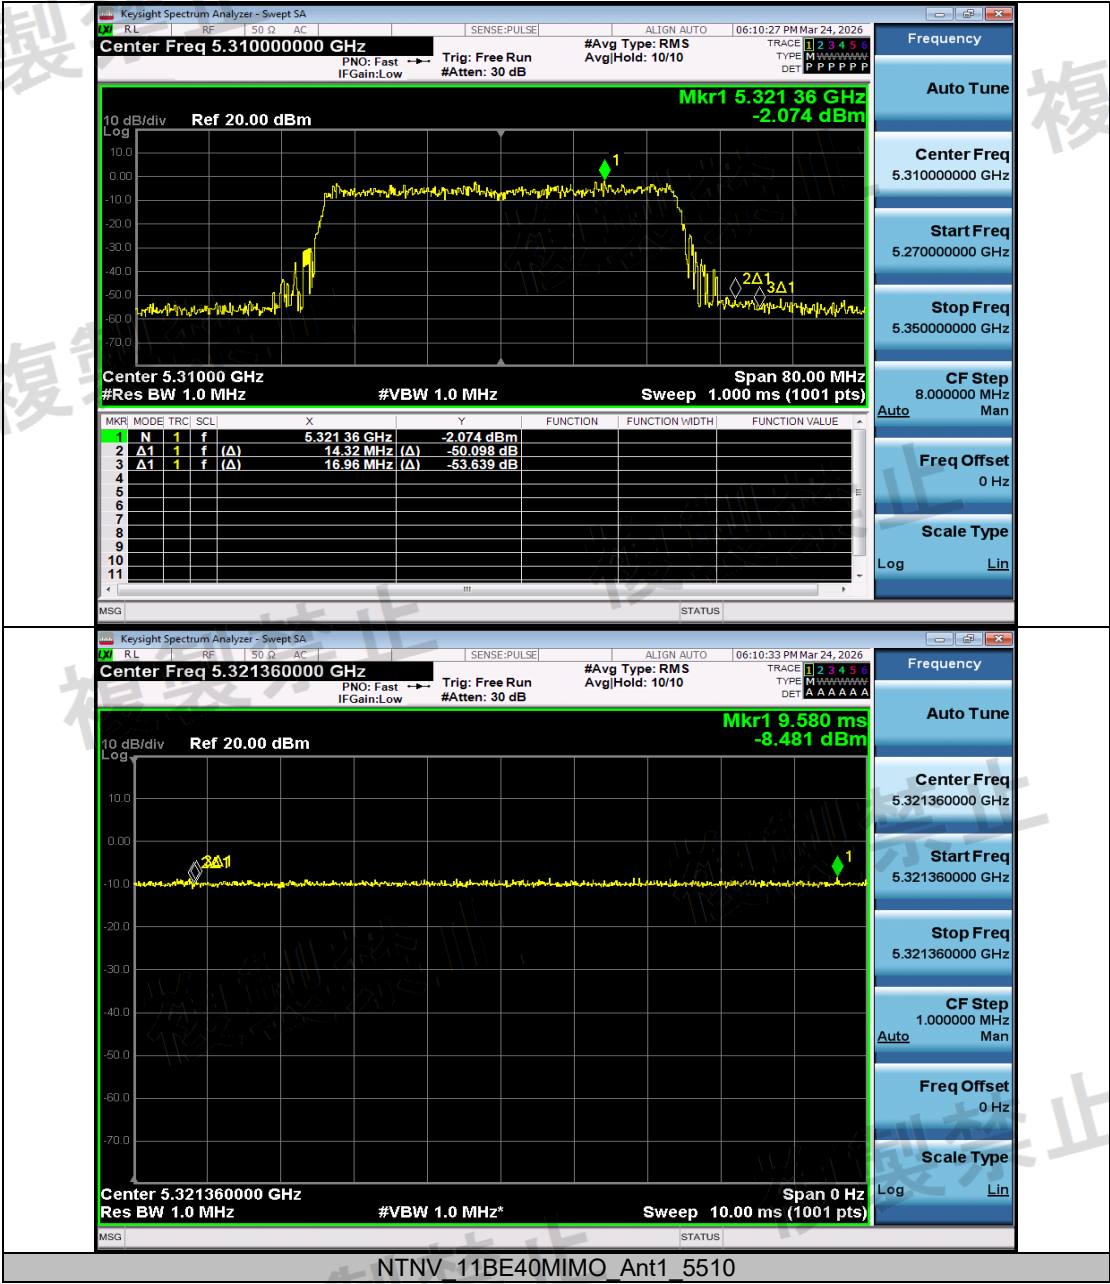


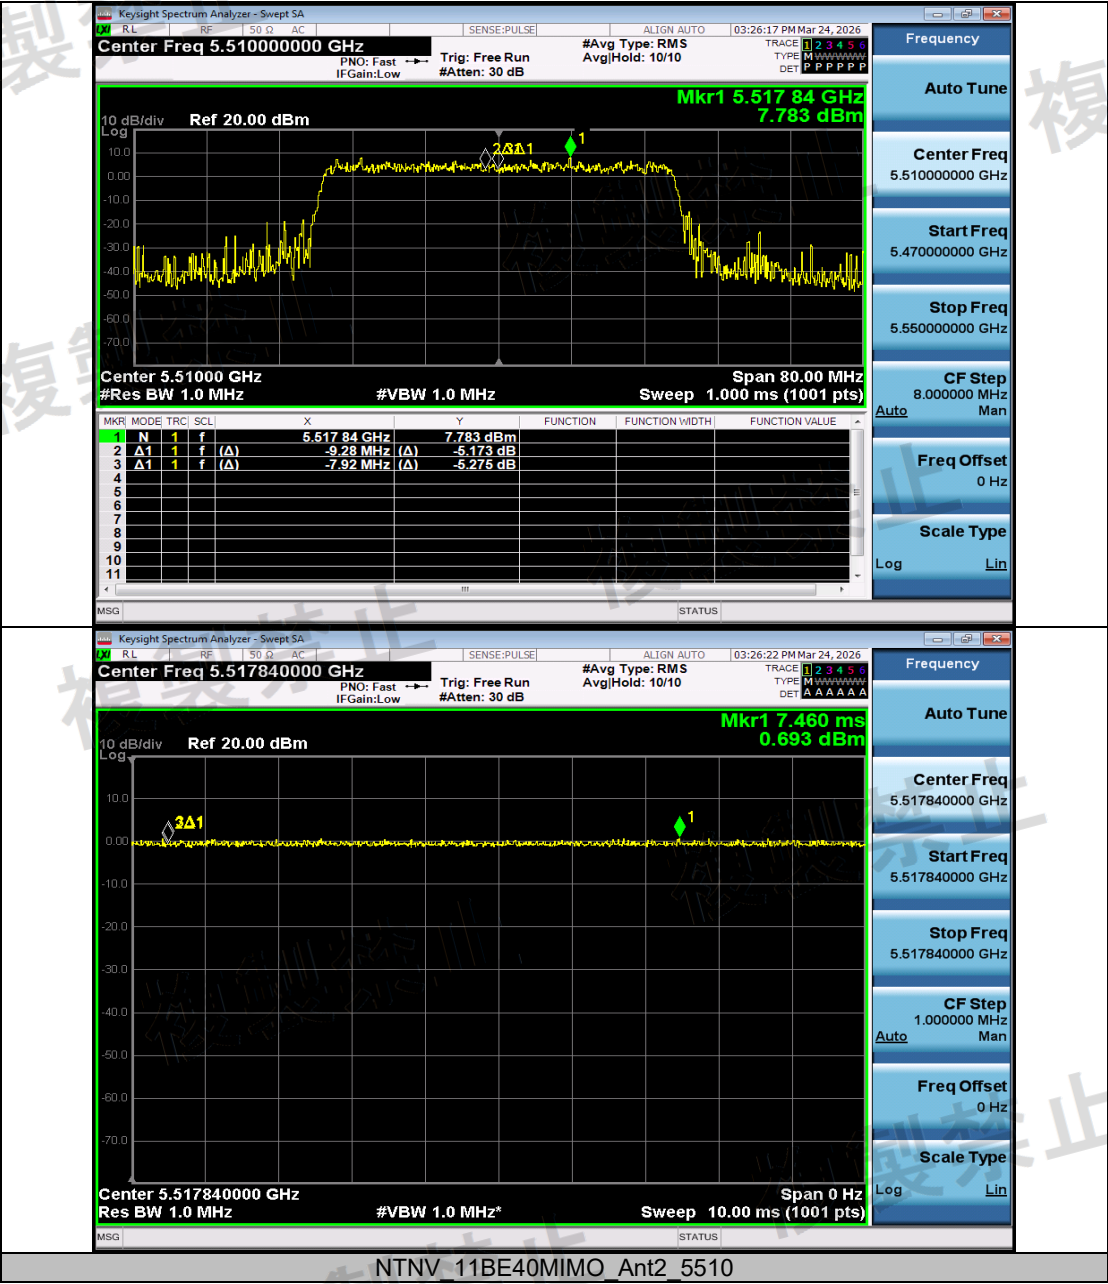


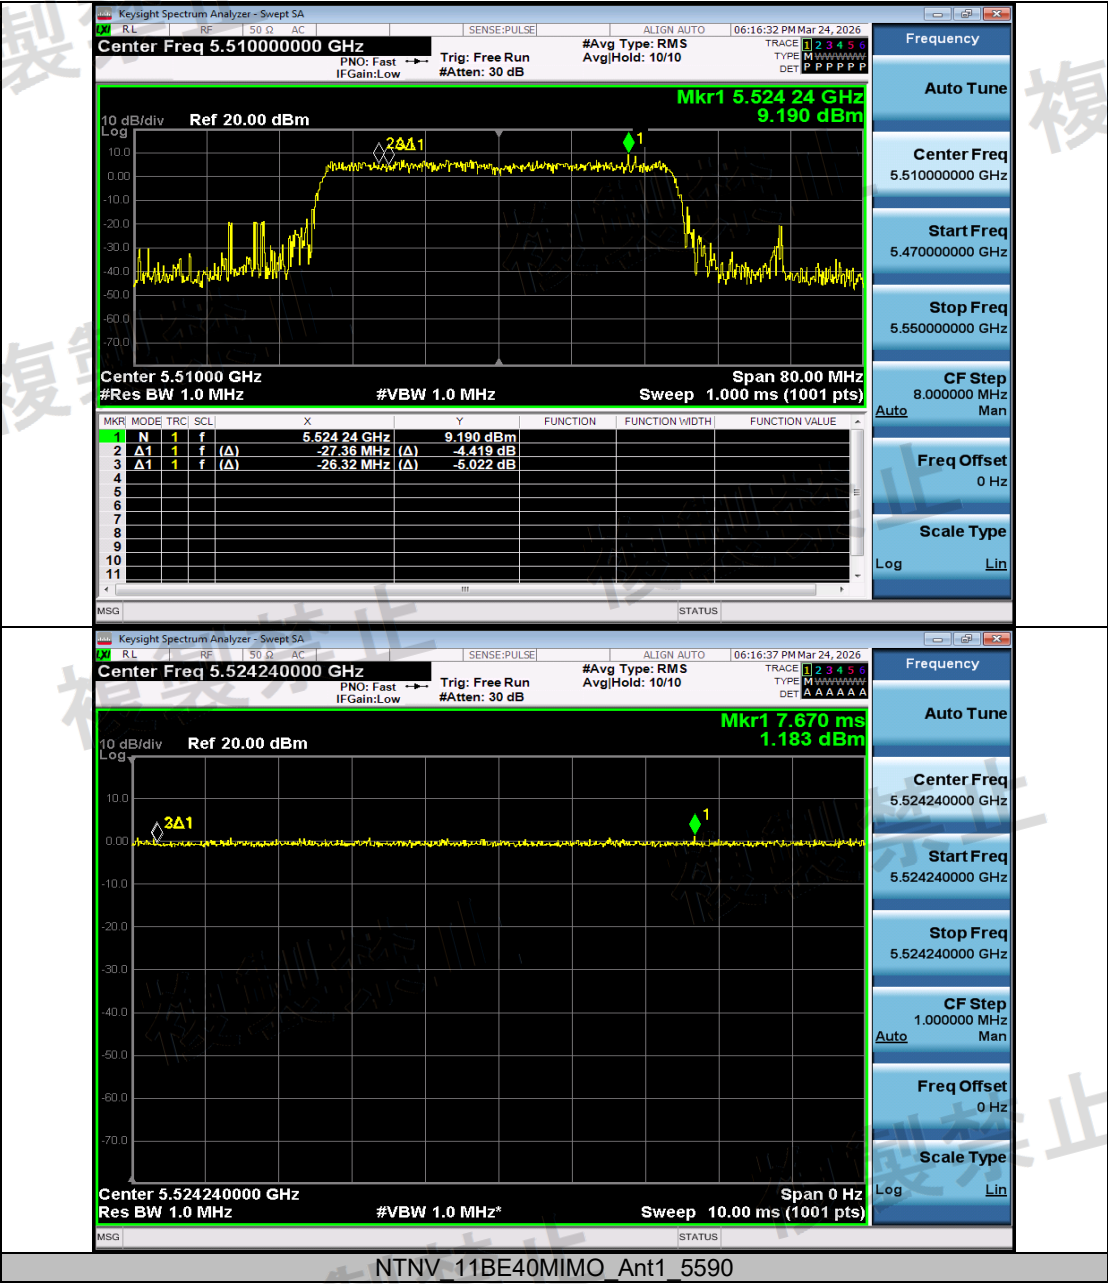


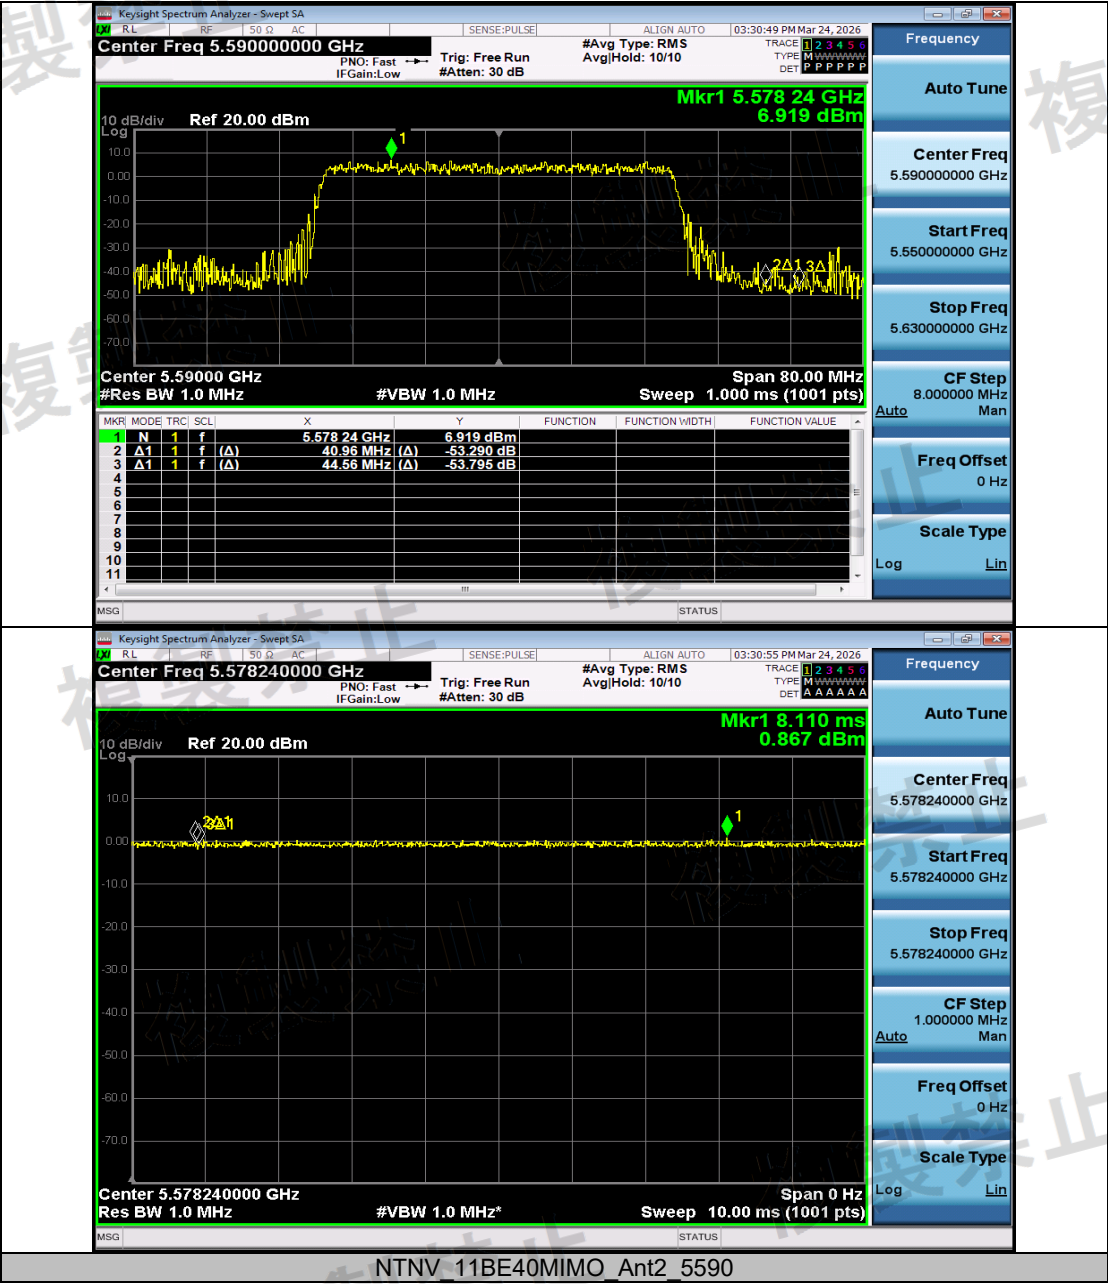


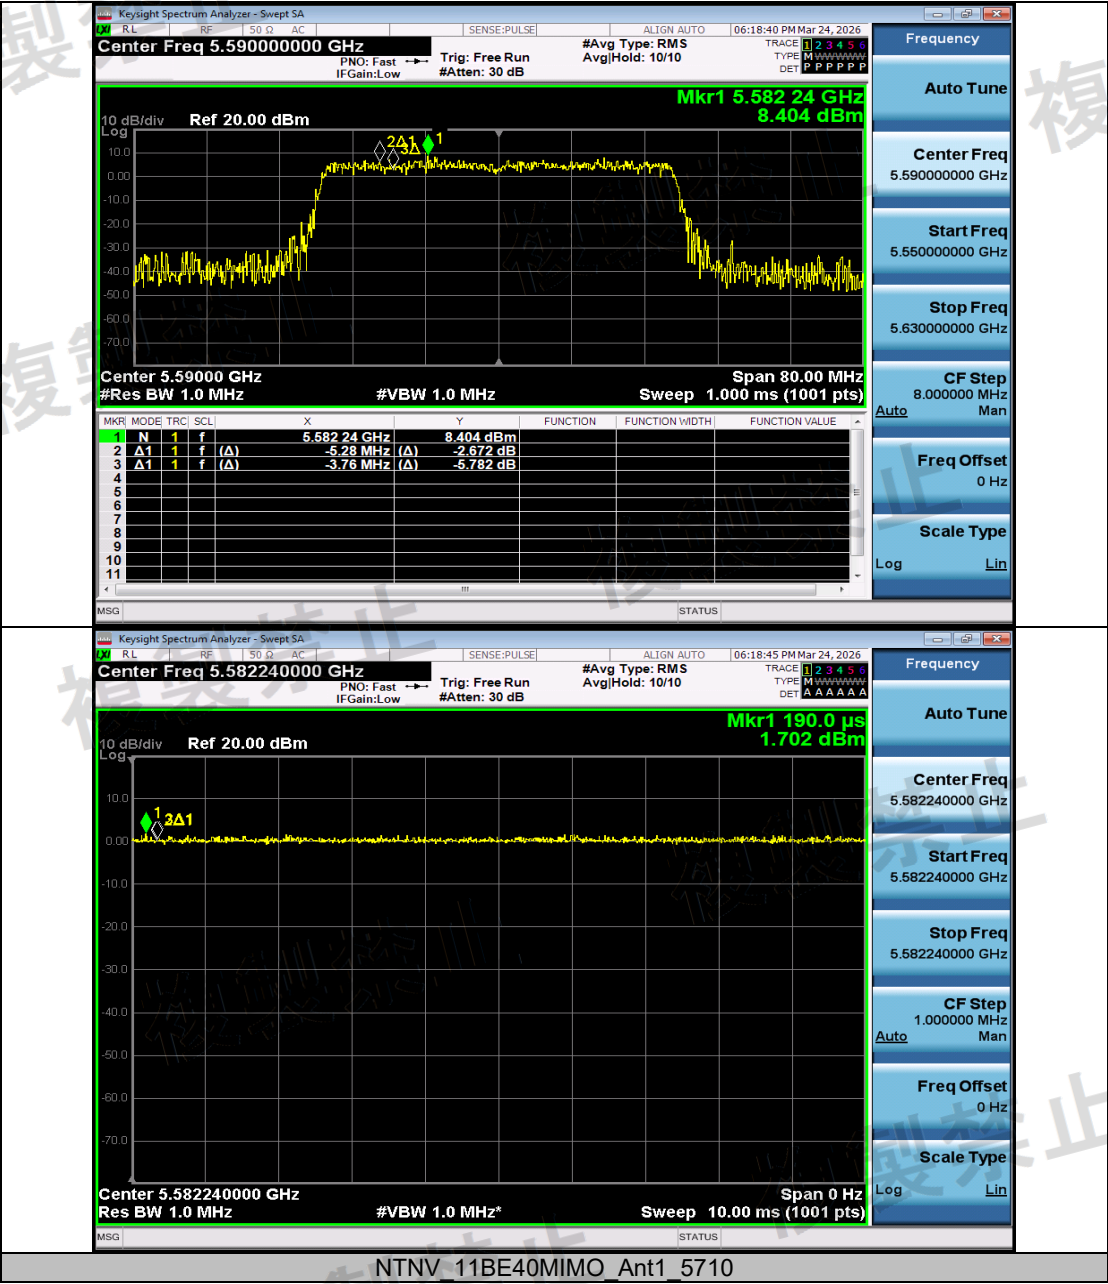


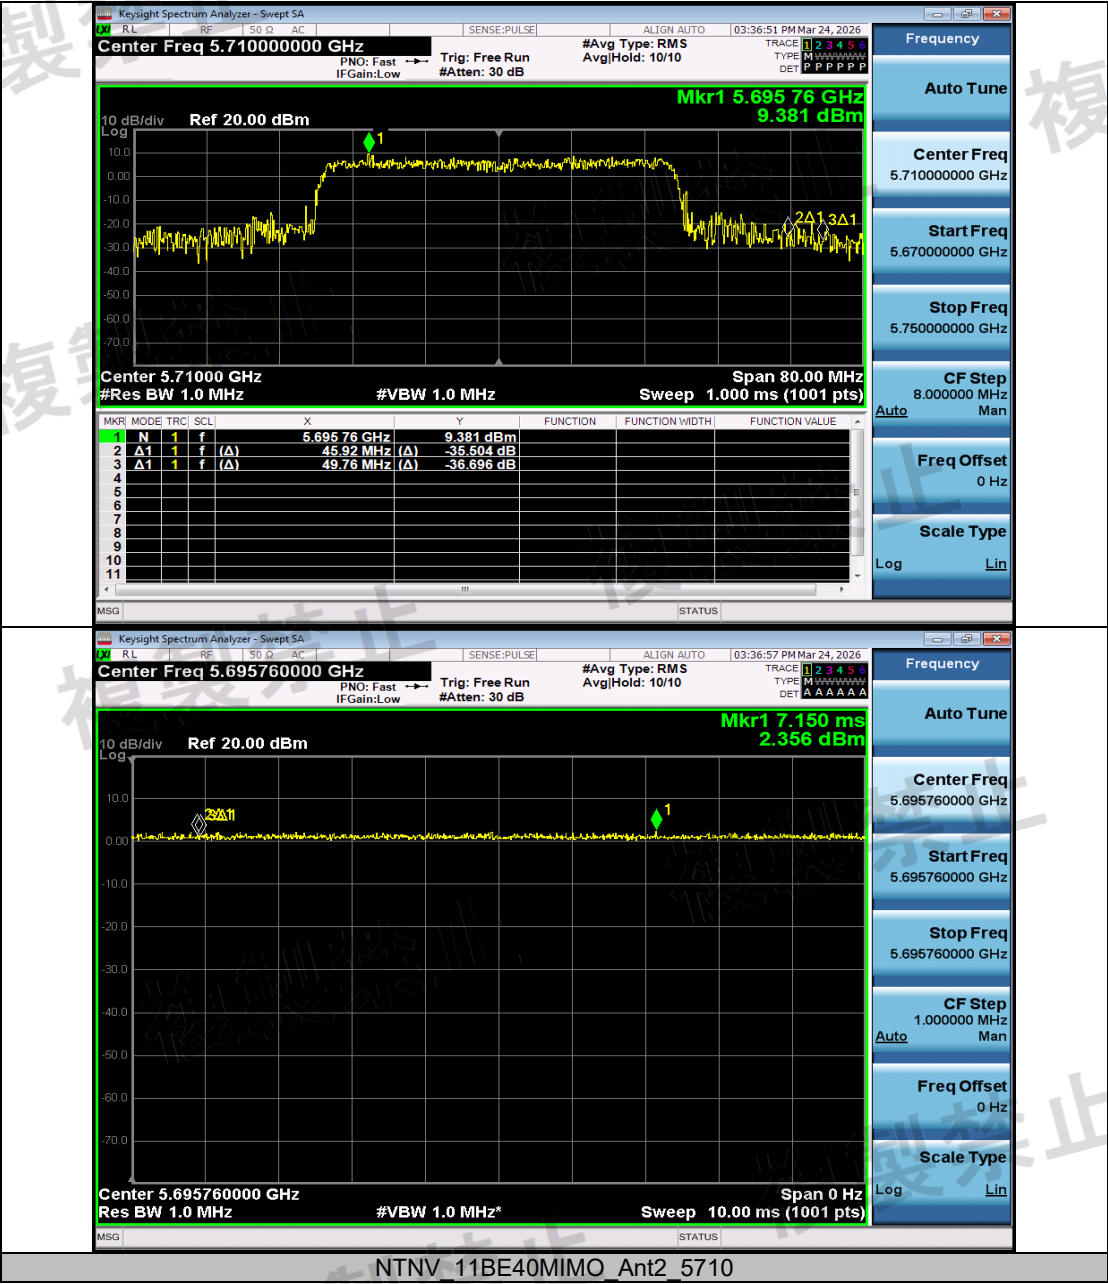


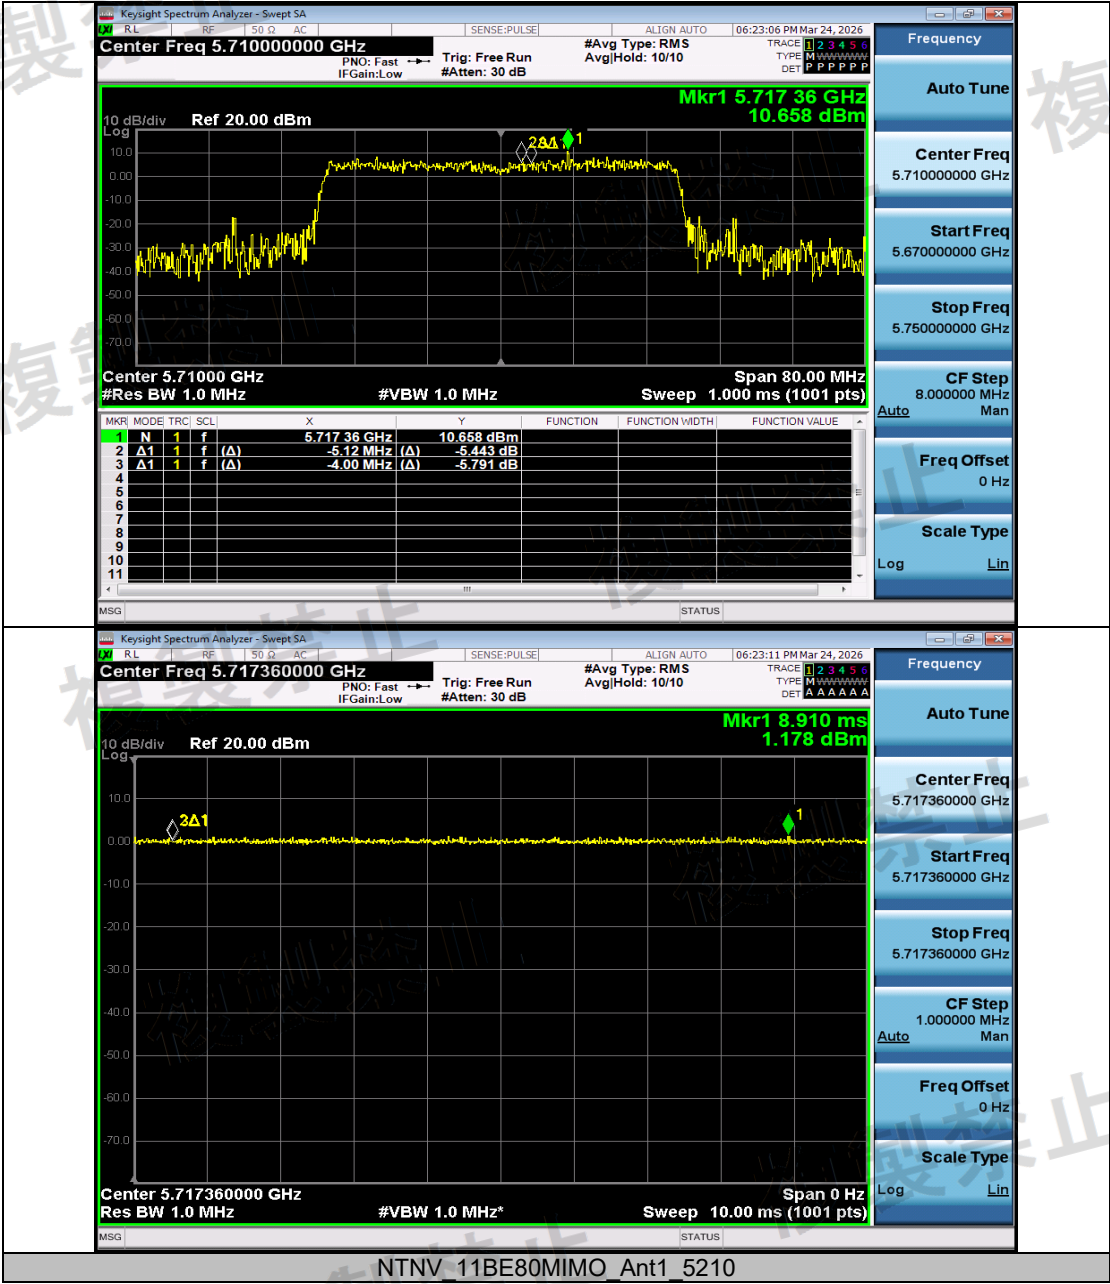


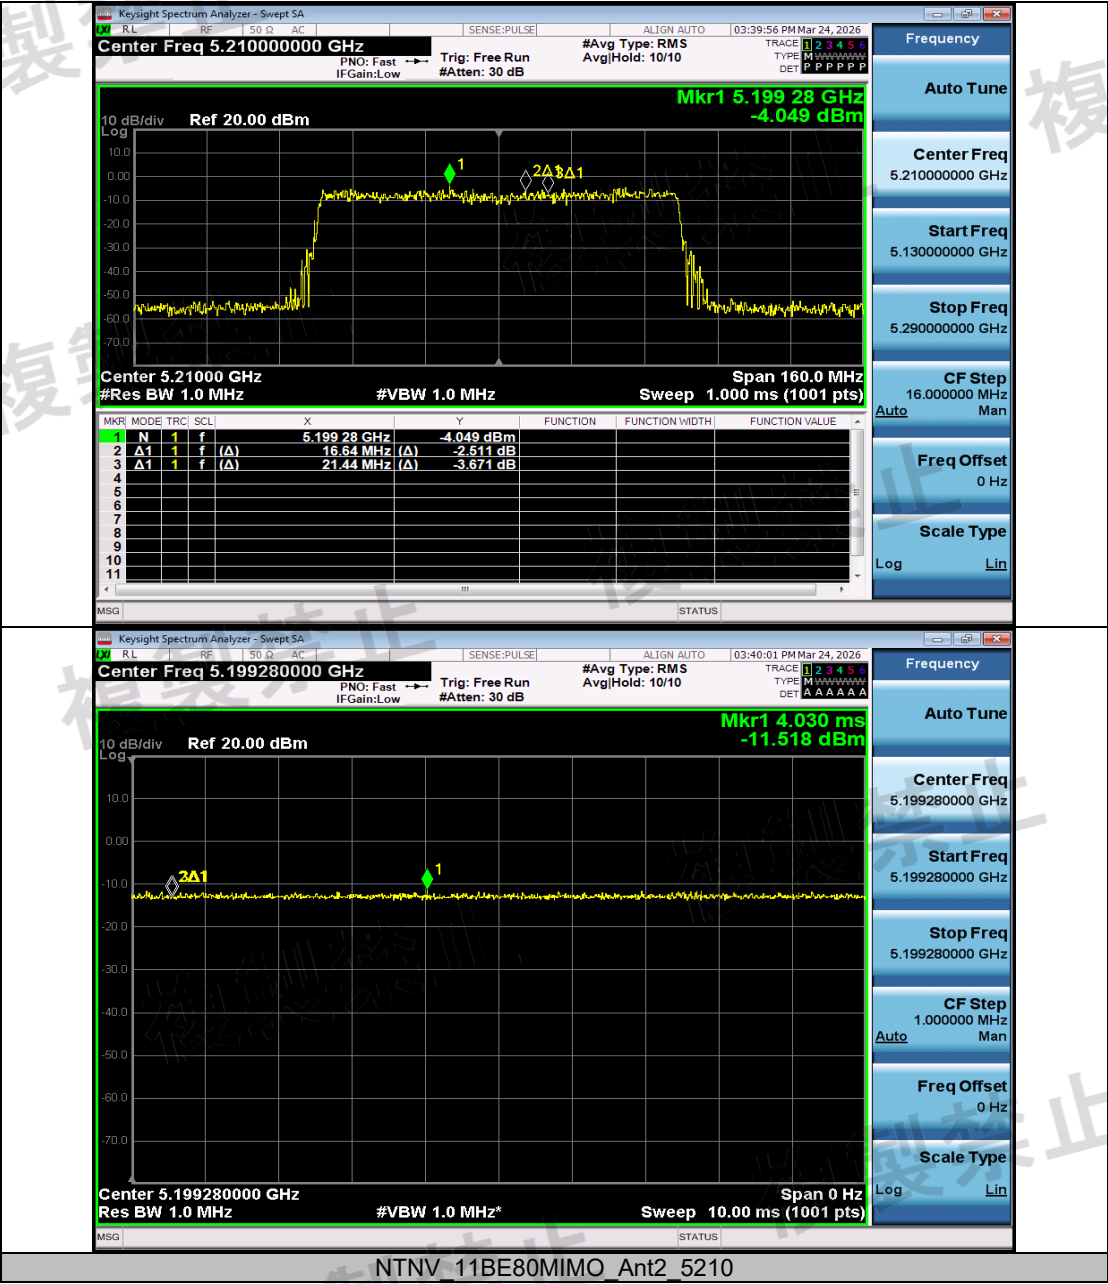


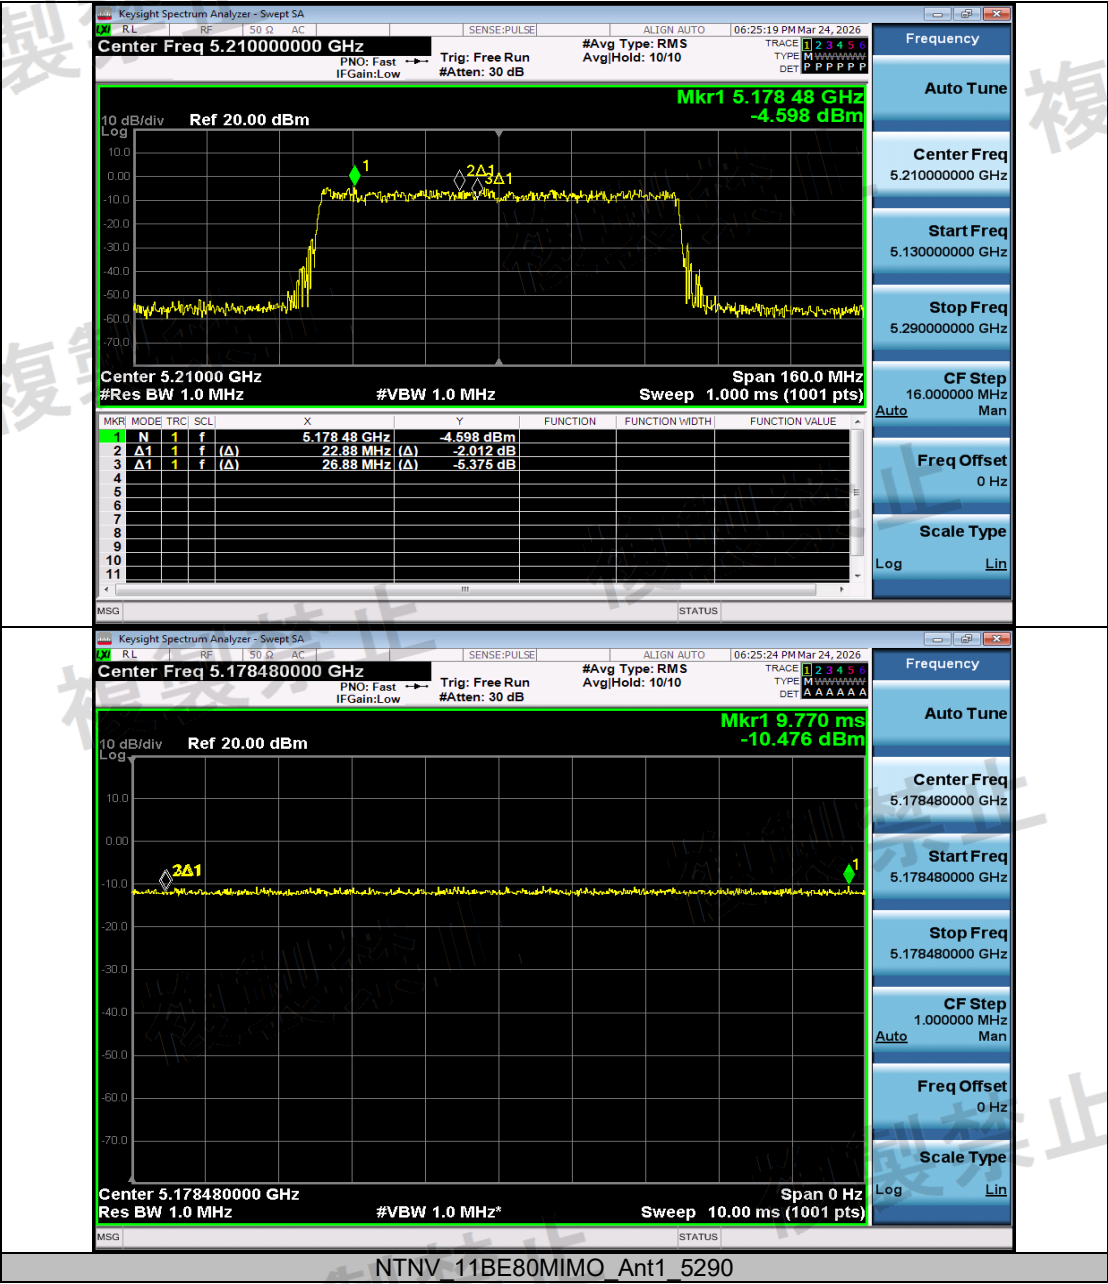


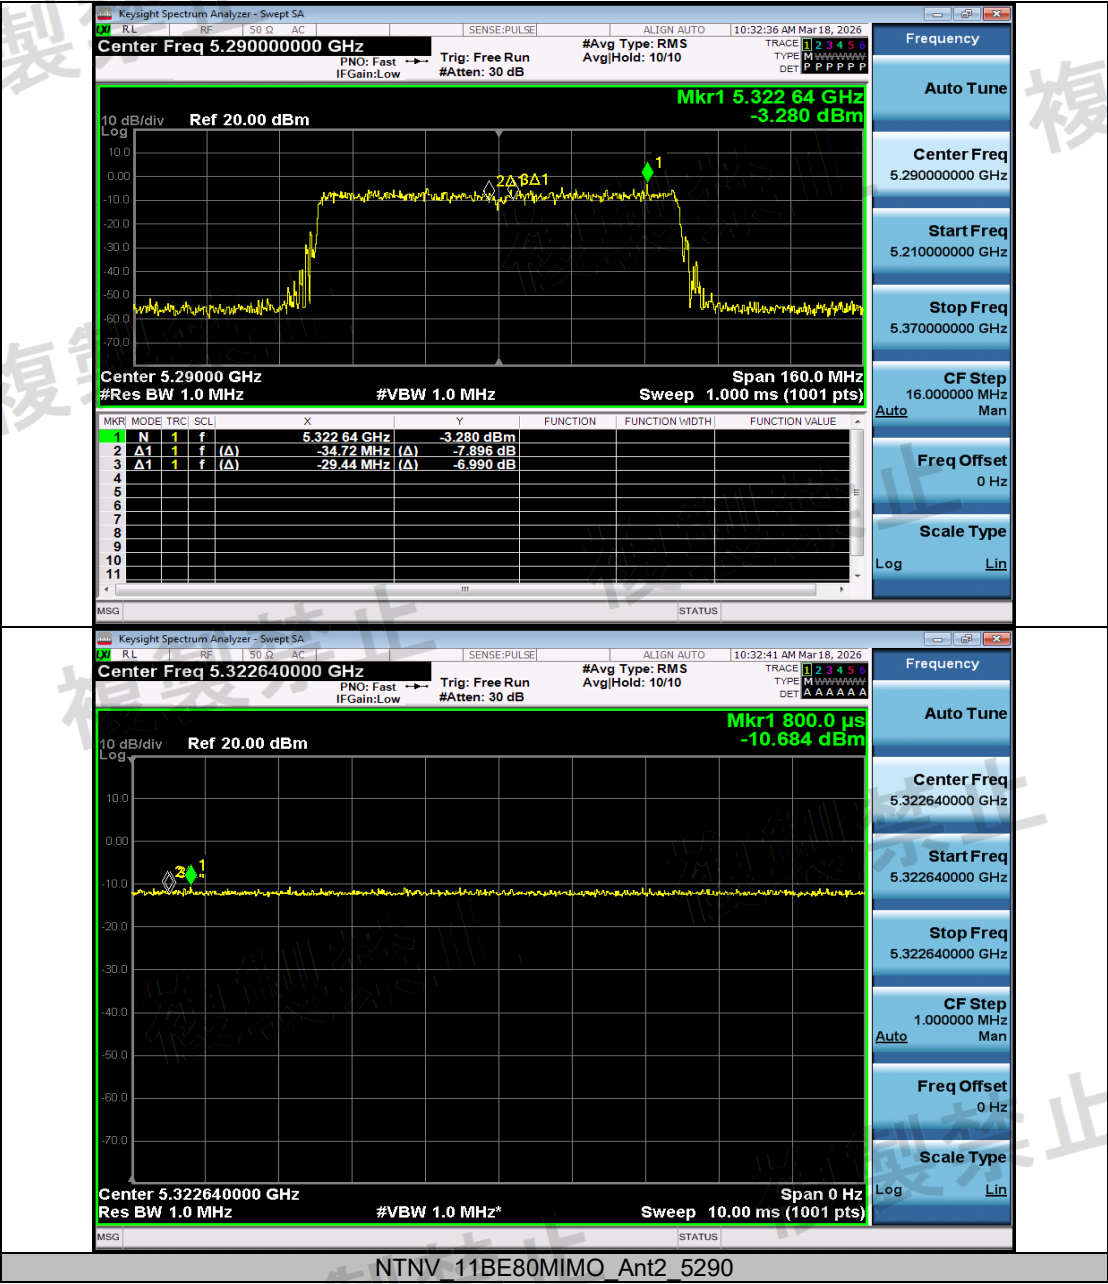


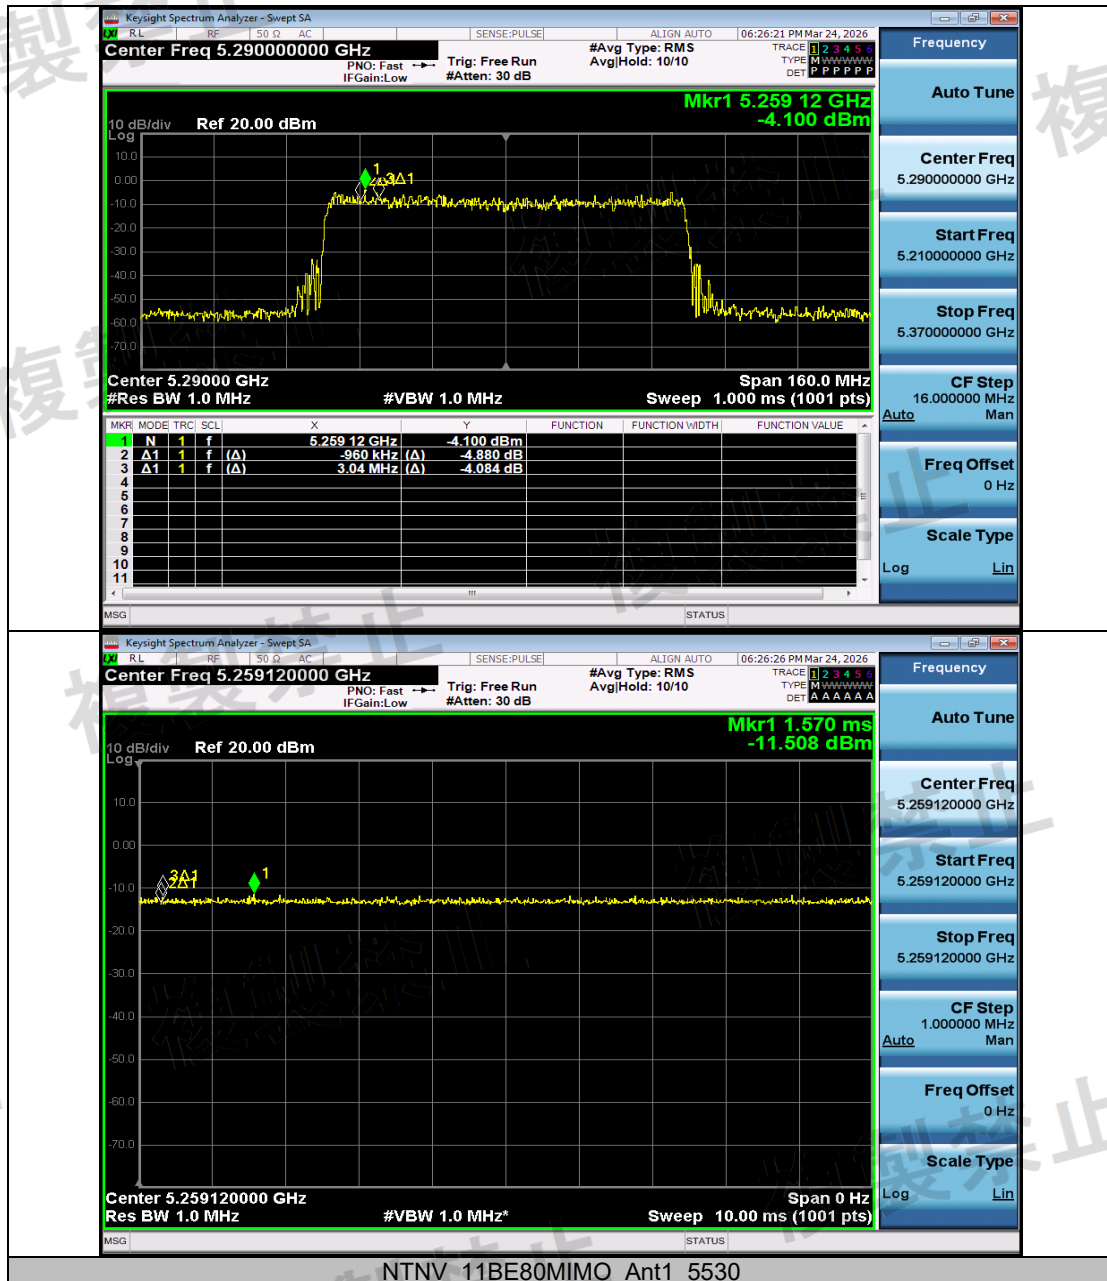


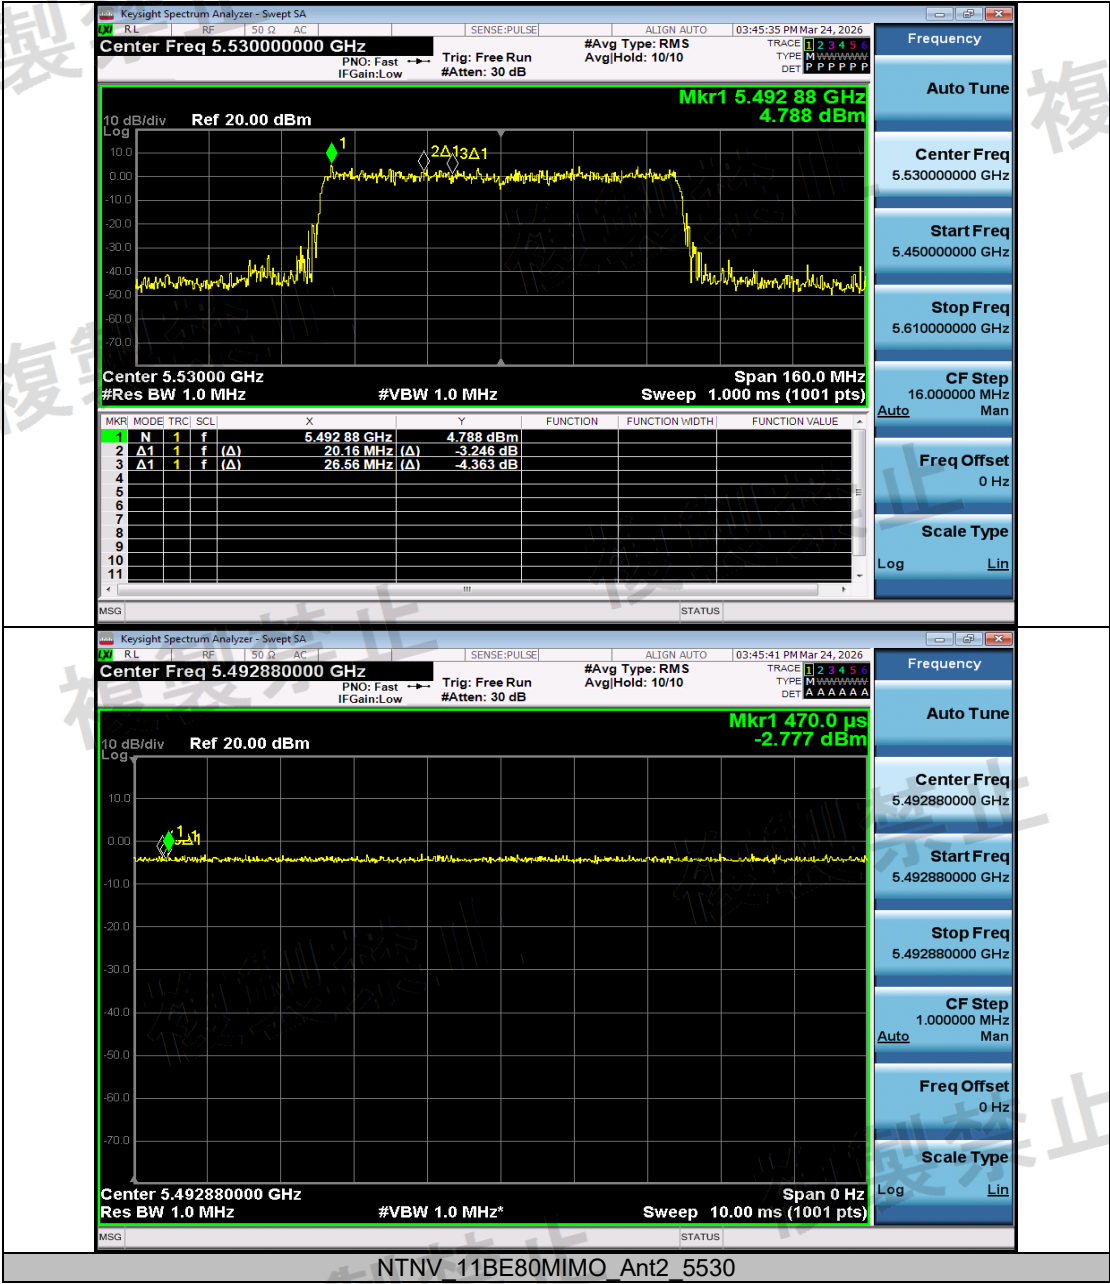


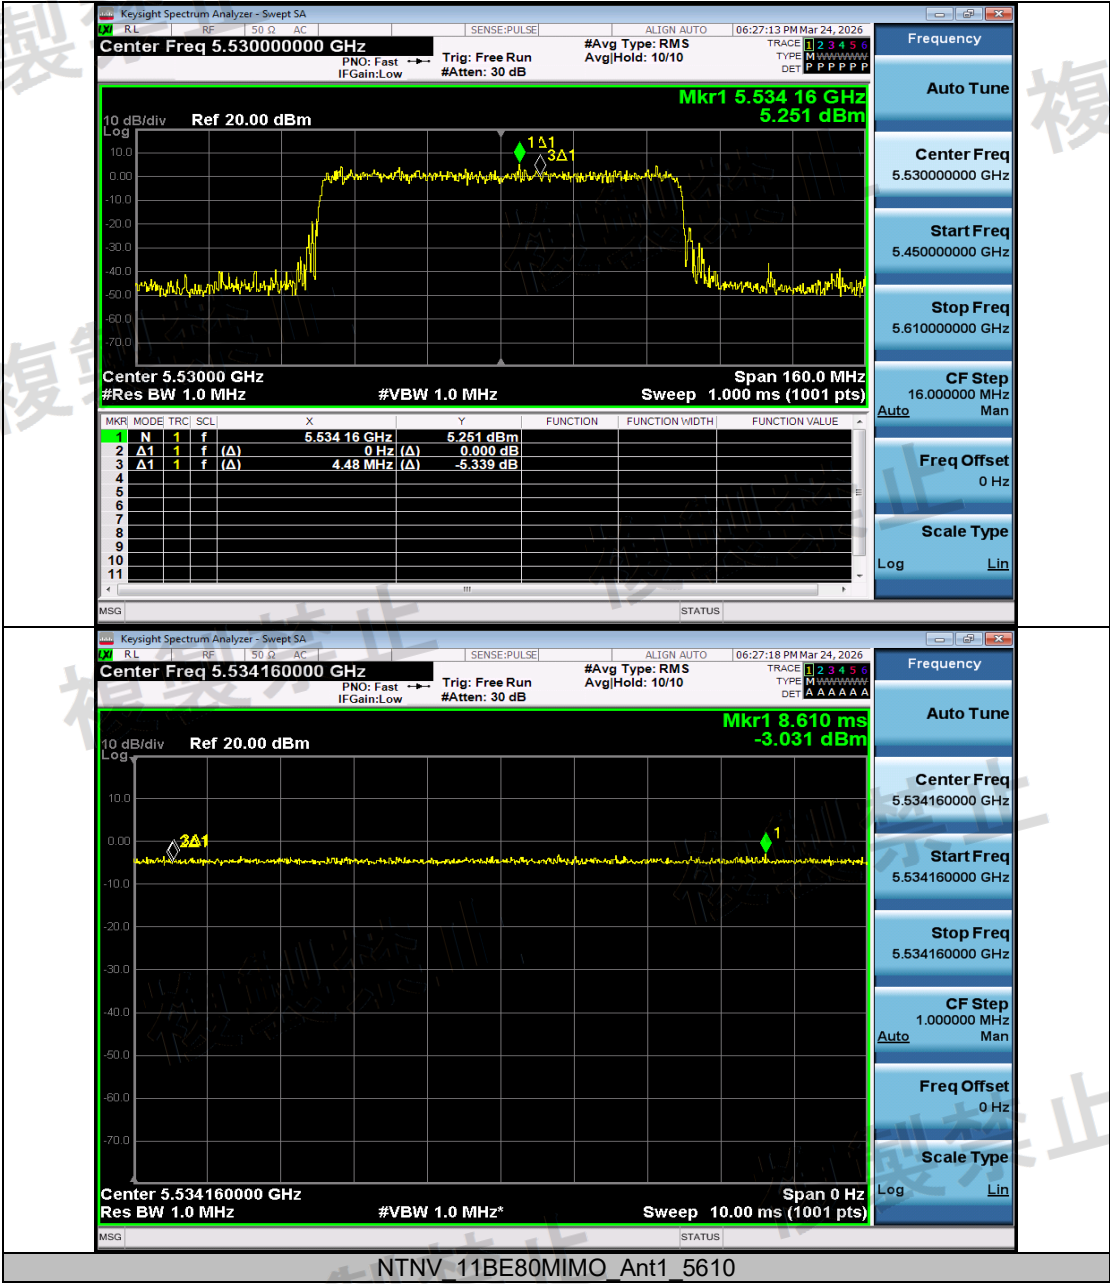


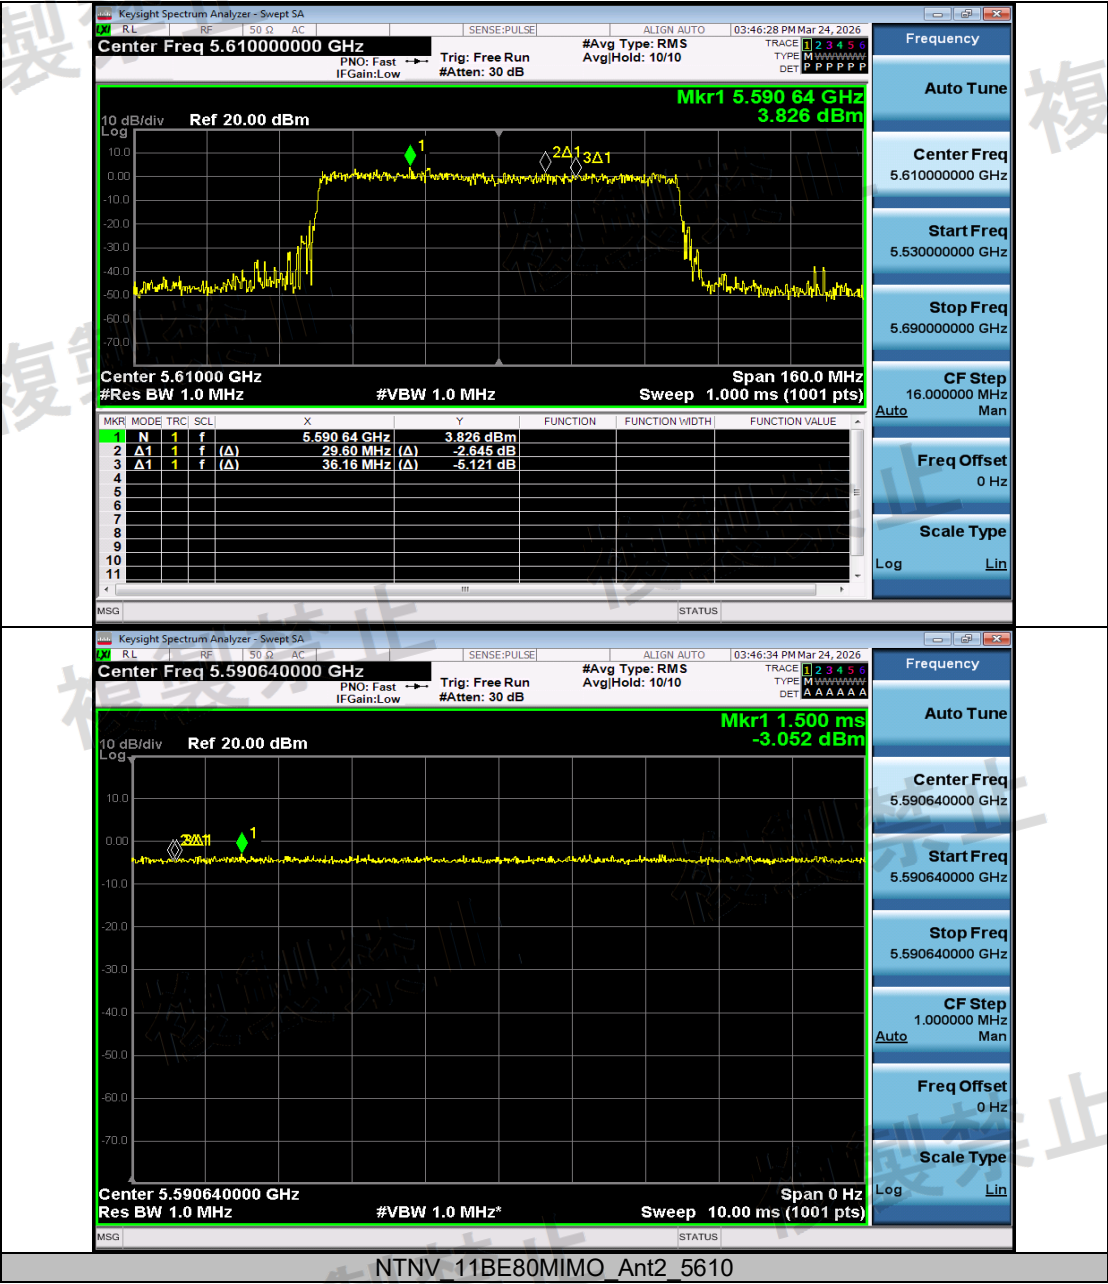


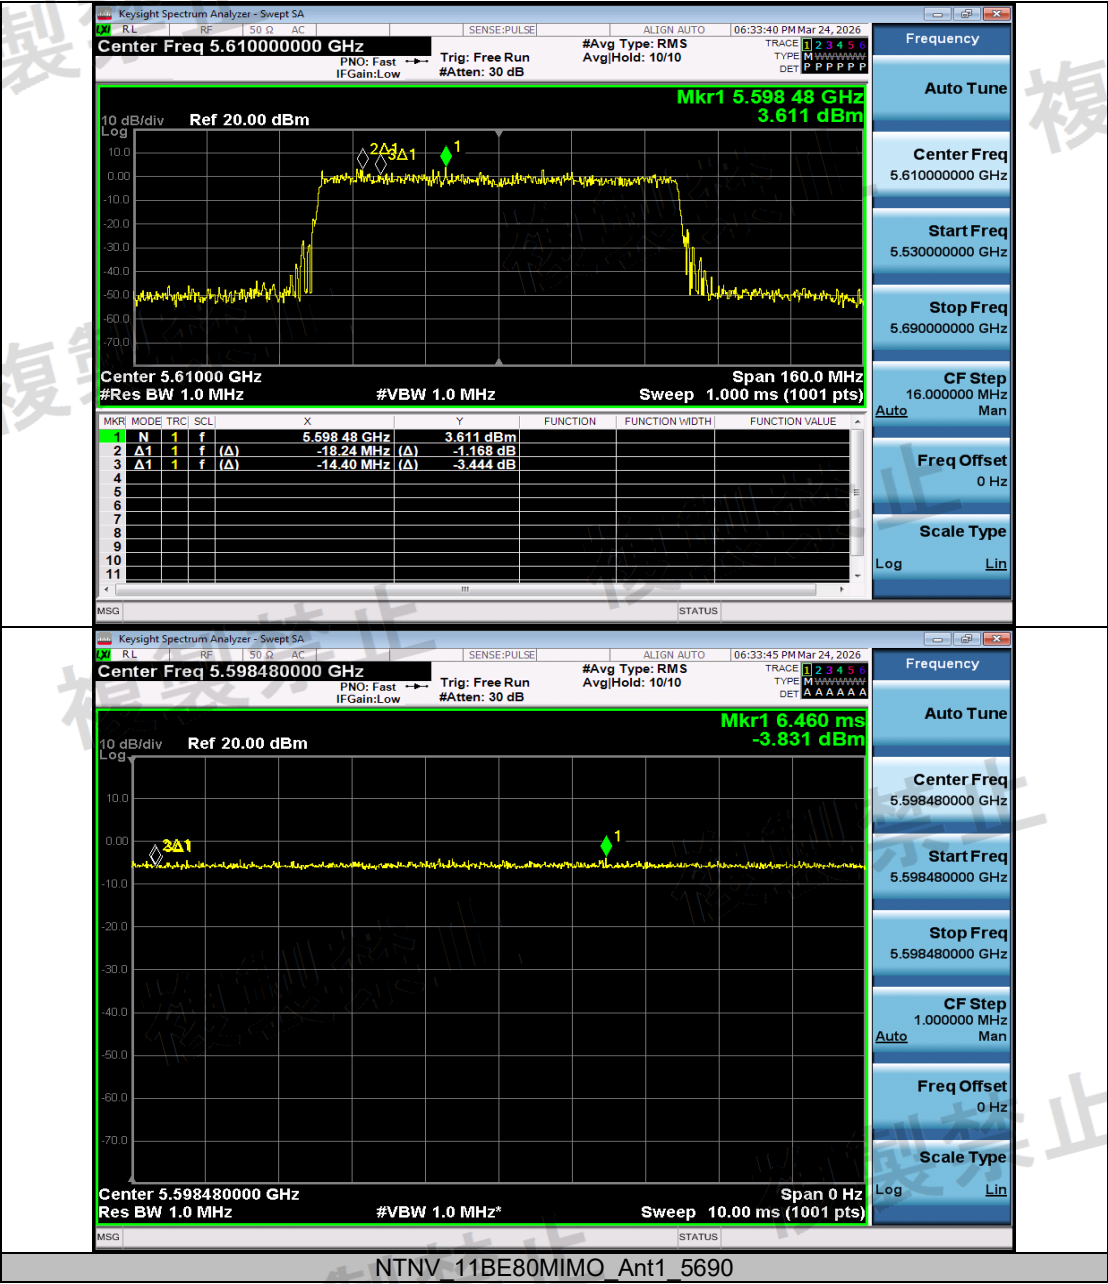


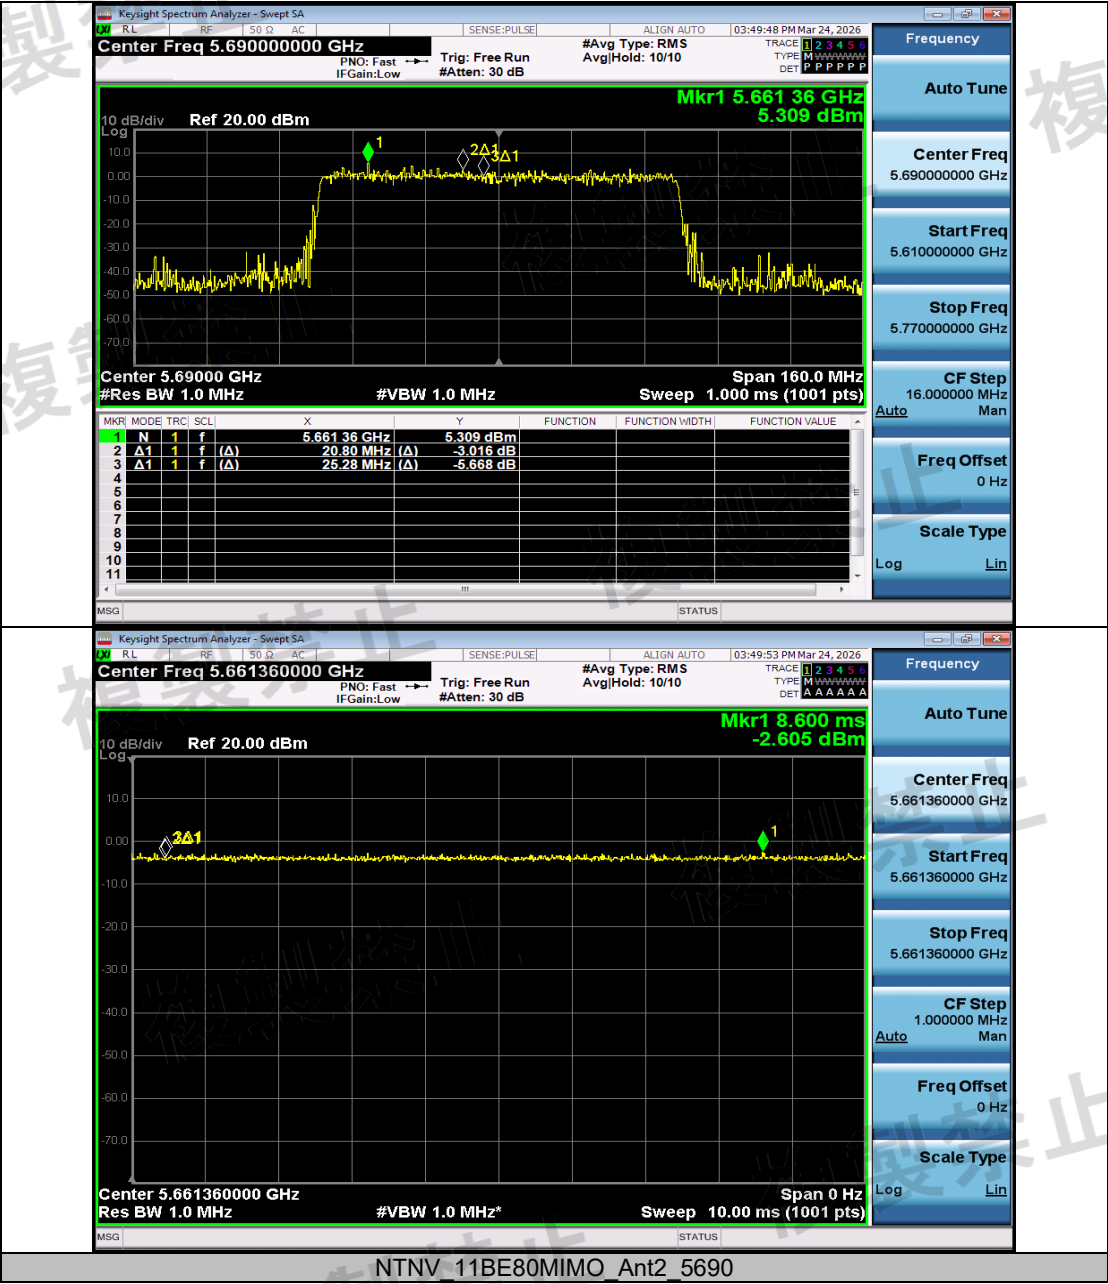


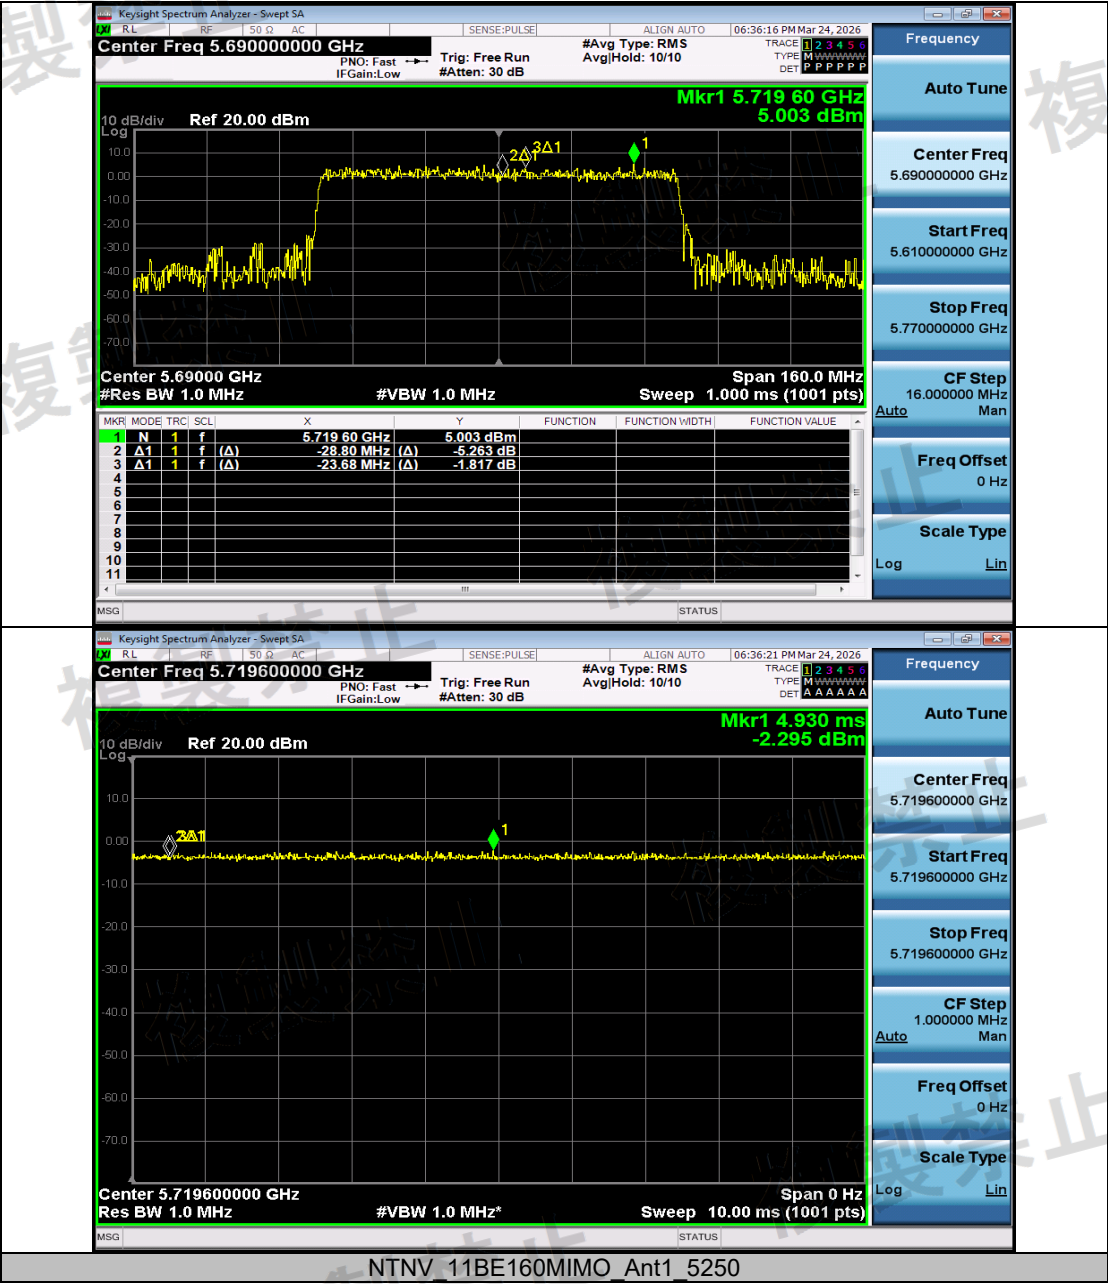

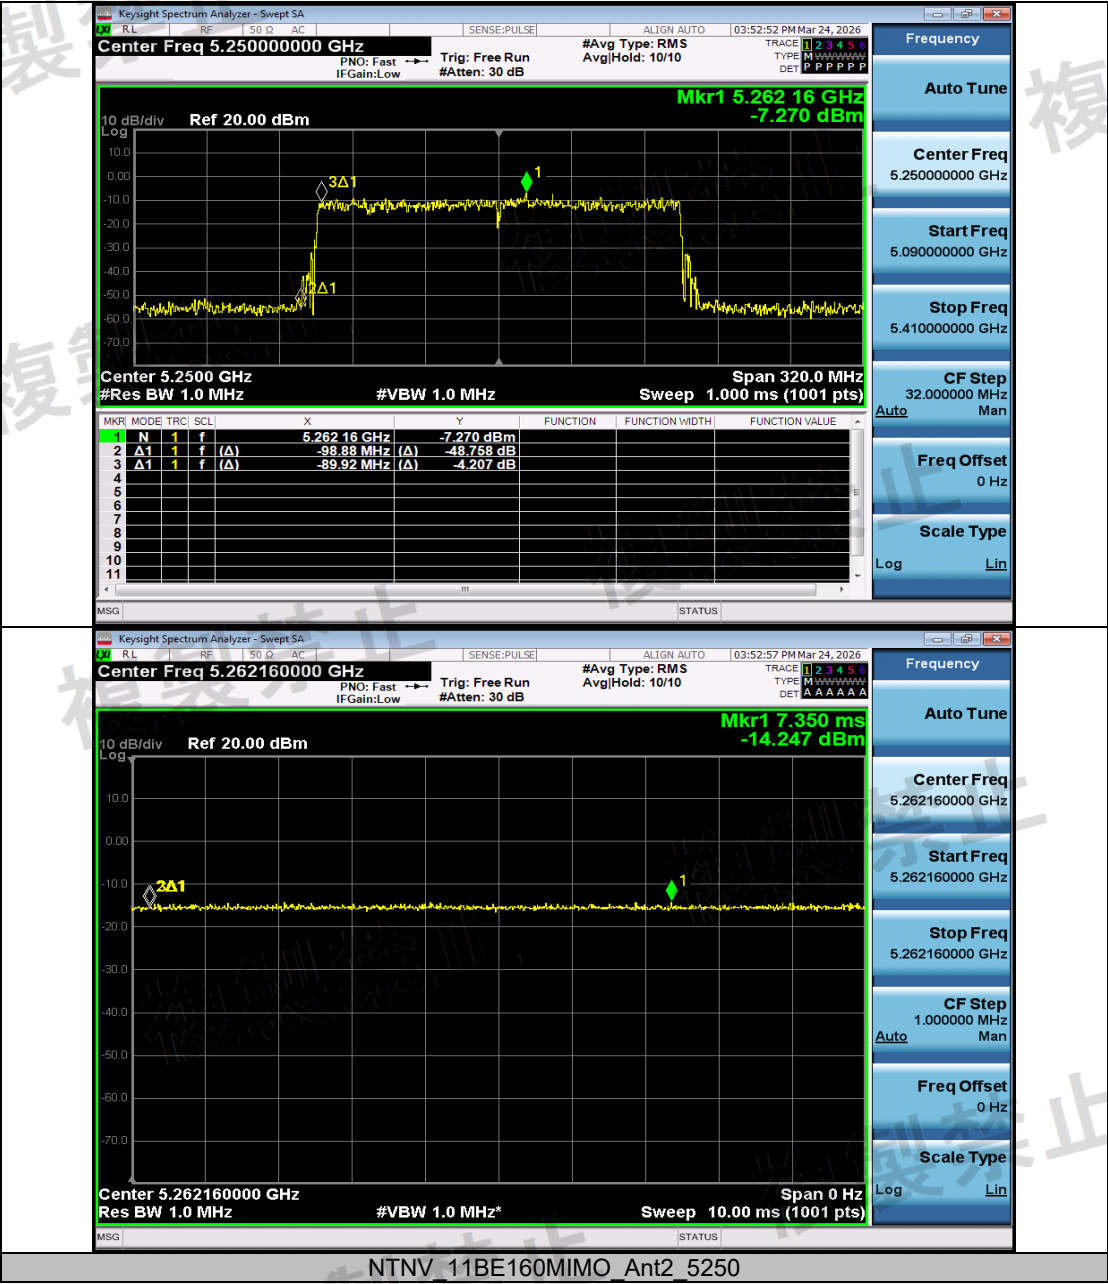

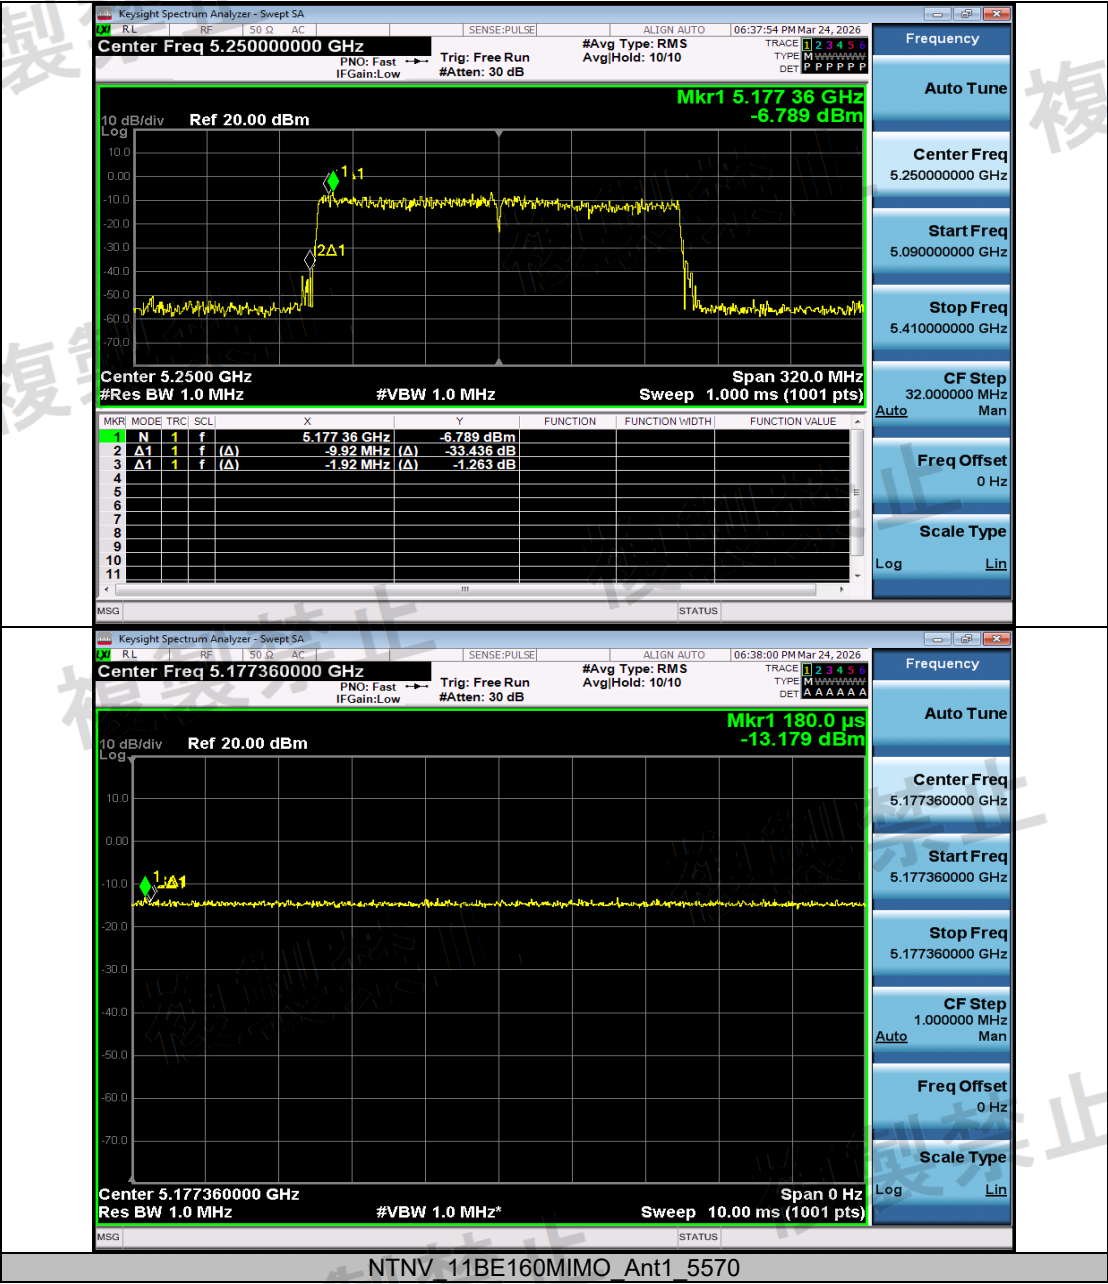

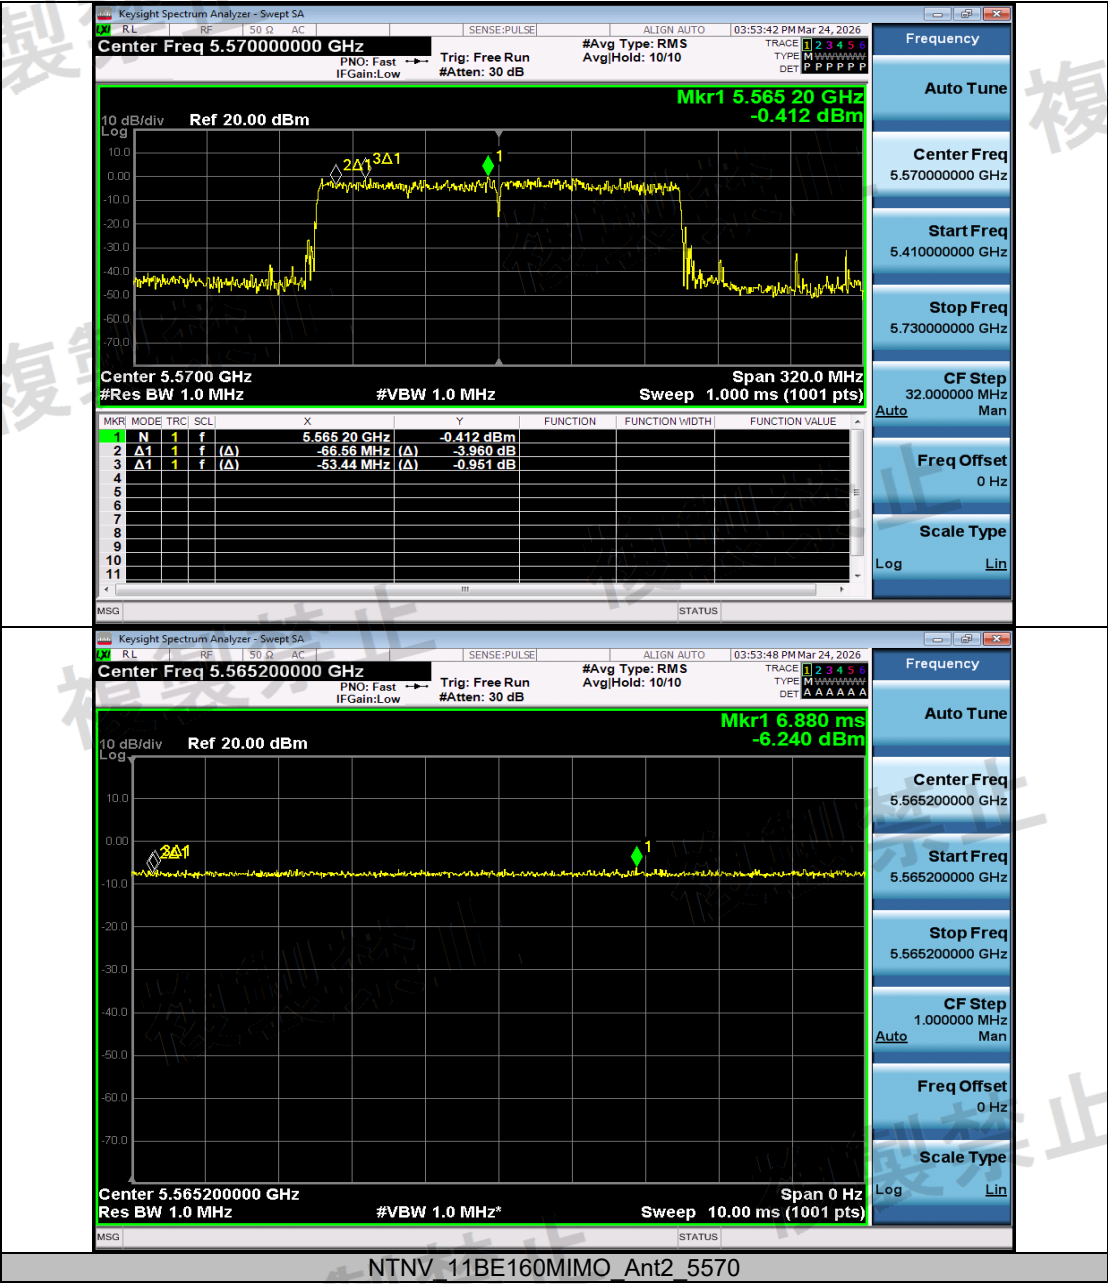

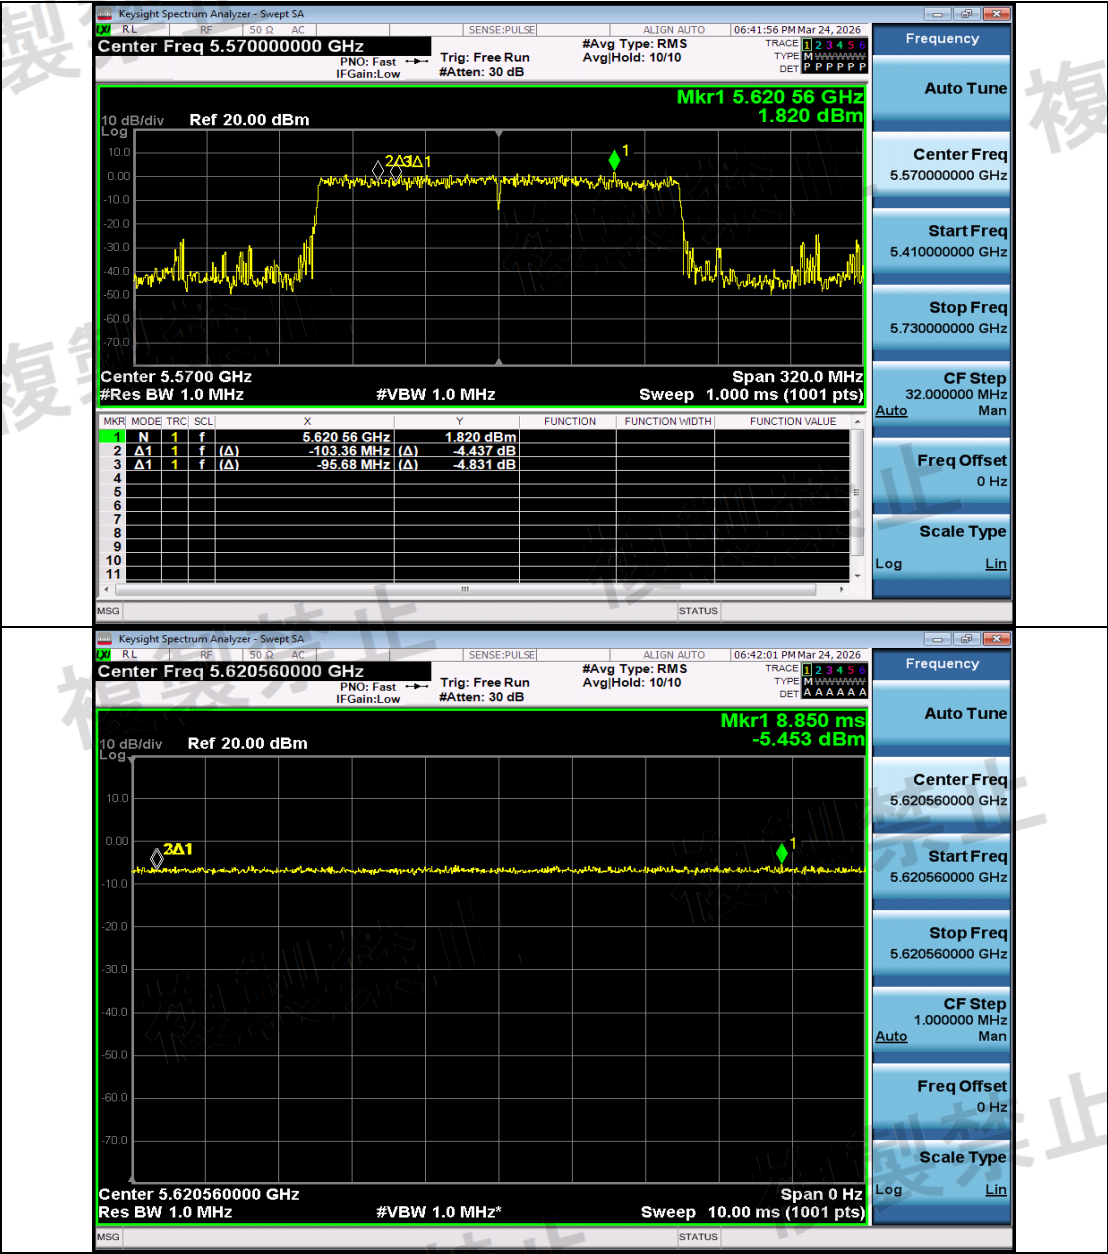

4. Appendix D: Leak Power of Neighboring Channels

4.1 Worst Case Test Result

Please refer to following data table and plots.

Test Condition	Test Mode	Antenna	Freq [MHz]	Offset [MHz]	Result [dBc]	Limit [dBc]	Verdict
NTNV	11A-CDD	Ant1	5180	-40	-56.59	≤-40	PASS
				-20	-34.91	≤-25	PASS
				+20	-35.10	≤-25	PASS
				+40	-57.26	≤-40	PASS
		Ant2	5180	-40	-56.10	≤-40	PASS
				-20	-35.69	≤-25	PASS
				+20	-35.76	≤-25	PASS
				+40	-56.29	≤-40	PASS
		total	5180	-40	-56.20	≤-40	PASS
				-20	-35.51	≤-25	PASS
				+20	-35.61	≤-25	PASS
				+40	-56.49	≤-40	PASS
		Ant1	5200	-40	-56.29	≤-40	PASS
				-20	-34.61	≤-25	PASS
				+20	-34.91	≤-25	PASS
				+40	-56.46	≤-40	PASS
		Ant2	5200	-40	-55.18	≤-40	PASS
				-20	-35.32	≤-25	PASS
				+20	-35.60	≤-25	PASS
				+40	-55.37	≤-40	PASS
		total	5200	-40	-55.39	≤-40	PASS
				-20	-35.16	≤-25	PASS
				+20	-35.45	≤-25	PASS
				+40	-55.57	≤-40	PASS
		Ant1	5240	-40	-57.25	≤-40	PASS
				-20	-35.57	≤-25	PASS
				+20	-34.42	≤-25	PASS
				+40	-56.43	≤-40	PASS
		Ant2	5240	-40	-56.49	≤-40	PASS
				-20	-36.07	≤-25	PASS
				+20	-35.01	≤-25	PASS
				+40	-54.52	≤-40	PASS
		total	5240	-40	-56.67	≤-40	PASS
				-20	-35.94	≤-25	PASS
				+20	-34.86	≤-25	PASS
				+40	-54.92	≤-40	PASS
		Ant1	5260	-40	-57.52	≤-40	PASS
				-20	-35.19	≤-25	PASS
				+20	-35.04	≤-25	PASS
				+40	-57.01	≤-40	PASS
		Ant2	5260	-40	-57.29	≤-40	PASS
				-20	-35.69	≤-25	PASS
				+20	-35.74	≤-25	PASS
				+40	-56.93	≤-40	PASS
		total	5260	-40	-57.34	≤-40	PASS
				-20	-35.57	≤-25	PASS
				+20	-35.57	≤-25	PASS
				+40	-56.95	≤-40	PASS
		Ant1	5280	-40	-56.72	≤-40	PASS
				-20	-34.85	≤-25	PASS
				+20	-35.31	≤-25	PASS
				+40	-56.16	≤-40	PASS
		Ant2	5280	-40	-56.26	≤-40	PASS
				-20	-35.41	≤-25	PASS
				+20	-35.41	≤-25	PASS
				+40	-56.49	≤-40	PASS
		total	5280	-40	-56.35	≤-40	PASS
				-20	-35.30	≤-25	PASS
				+20	-35.39	≤-25	PASS
				+40	-56.43	≤-40	PASS
		Ant1	5320	-40	-56.83	≤-40	PASS
				-20	-35.39	≤-25	PASS
				+20	-34.18	≤-25	PASS

11N20MIM O		Ant2	5320	+40	-55.61	≤-40	PASS
				-40	-55.60	≤-40	PASS
				-20	-36.25	≤-25	PASS
				+20	-34.52	≤-25	PASS
		total	5320	+40	-55.79	≤-40	PASS
				-40	-55.80	≤-40	PASS
				-20	-36.07	≤-25	PASS
				+20	-34.45	≤-25	PASS
		Ant1	5500	+40	-55.75	≤-40	PASS
				-40	-56.53	≤-40	PASS
				-20	-32.89	≤-25	PASS
				+20	-32.51	≤-25	PASS
		Ant2	5500	+40	-56.12	≤-40	PASS
				-40	-54.89	≤-40	PASS
				-20	-33.72	≤-25	PASS
				+20	-32.94	≤-25	PASS
		total	5500	+40	-55.04	≤-40	PASS
				-40	-55.19	≤-40	PASS
				-20	-33.53	≤-25	PASS
				+20	-32.85	≤-25	PASS
		Ant1	5600	+40	-55.25	≤-40	PASS
				-40	-54.58	≤-40	PASS
				-20	-31.46	≤-25	PASS
				+20	-32.21	≤-25	PASS
		Ant2	5600	+40	-55.90	≤-40	PASS
				-40	-55.03	≤-40	PASS
				-20	-32.65	≤-25	PASS
				+20	-34.03	≤-25	PASS
		total	5600	+40	-56.49	≤-40	PASS
				-40	-54.93	≤-40	PASS
				-20	-32.37	≤-25	PASS
				+20	-33.57	≤-25	PASS
		Ant1	5720	+40	-56.36	≤-40	PASS
				-40	-54.79	≤-40	PASS
				-20	-32.98	≤-25	PASS
				+20	-32.90	≤-25	PASS
		Ant2	5720	+40	-55.20	≤-40	PASS
				-40	-53.77	≤-40	PASS
				-20	-32.29	≤-25	PASS
				+20	-32.56	≤-25	PASS
		total	5720	+40	-52.86	≤-40	PASS
				-40	-53.95	≤-40	PASS
				-20	-32.41	≤-25	PASS
				+20	-32.62	≤-25	PASS
		Ant1	5180	+40	-53.22	≤-40	PASS
				-40	-56.36	≤-40	PASS
				-20	-32.48	≤-25	PASS
				+20	-32.51	≤-25	PASS
		Ant2	5180	+40	-56.87	≤-40	PASS
				-40	-57.30	≤-40	PASS
				-20	-33.36	≤-25	PASS
				+20	-33.15	≤-25	PASS
		total	5180	+40	-57.65	≤-40	PASS
				-40	-57.08	≤-40	PASS
				-20	-33.16	≤-25	PASS
				+20	-33.00	≤-25	PASS
		Ant1	5200	+40	-57.47	≤-40	PASS
				-40	-56.01	≤-40	PASS
				-20	-32.60	≤-25	PASS
				+20	-32.61	≤-25	PASS
		Ant2	5200	+40	-56.11	≤-40	PASS
				-40	-56.13	≤-40	PASS
				-20	-33.21	≤-25	PASS
				+20	-32.92	≤-25	PASS
		total	5200	+40	-56.09	≤-40	PASS
				-40	-56.10	≤-40	PASS
				-20	-33.08	≤-25	PASS
				+20	-32.85	≤-25	PASS
		Ant1	5240	+40	-56.09	≤-40	PASS
				-40	-57.16	≤-40	PASS
				-20	-33.07	≤-25	PASS

				+20	-32.16	≤-25	PASS
				+40	-56.64	≤-40	PASS
				-40	-49.16	≤-40	PASS
				-20	-31.48	≤-25	PASS
Ant2	5240			+20	-30.90	≤-25	PASS
				+40	-48.60	≤-40	PASS
				-40	-49.39	≤-40	PASS
				-20	-31.67	≤-25	PASS
total	5240			+20	-31.16	≤-25	PASS
				+40	-48.89	≤-40	PASS
				-40	-57.18	≤-40	PASS
				-20	-32.91	≤-25	PASS
Ant1	5260			+20	-32.37	≤-25	PASS
				+40	-56.71	≤-40	PASS
				-40	-57.80	≤-40	PASS
				-20	-33.54	≤-25	PASS
Ant2	5260			+20	-33.01	≤-25	PASS
				+40	-57.61	≤-40	PASS
				-40	-57.67	≤-40	PASS
				-20	-33.41	≤-25	PASS
total	5260			+20	-32.88	≤-25	PASS
				+40	-57.42	≤-40	PASS
				-40	-56.73	≤-40	PASS
				-20	-32.40	≤-25	PASS
Ant1	5280			+20	-32.43	≤-25	PASS
				+40	-56.23	≤-40	PASS
				-40	-57.16	≤-40	PASS
				-20	-32.88	≤-25	PASS
Ant2	5280			+20	-33.07	≤-25	PASS
				+40	-57.04	≤-40	PASS
				-40	-57.08	≤-40	PASS
				-20	-32.79	≤-25	PASS
total	5280			+20	-32.94	≤-25	PASS
				+40	-56.88	≤-40	PASS
				-40	-57.04	≤-40	PASS
				-20	-32.69	≤-25	PASS
Ant1	5320			+20	-31.57	≤-25	PASS
				+40	-55.69	≤-40	PASS
				-40	-57.35	≤-40	PASS
				-20	-33.90	≤-25	PASS
Ant2	5320			+20	-32.16	≤-25	PASS
				+40	-56.30	≤-40	PASS
				-40	-57.28	≤-40	PASS
				-20	-33.64	≤-25	PASS
total	5320			+20	-32.04	≤-25	PASS
				+40	-56.17	≤-40	PASS
				-40	-54.66	≤-40	PASS
				-20	-31.36	≤-25	PASS
Ant1	5500			+20	-30.44	≤-25	PASS
				+40	-54.87	≤-40	PASS
				-40	-52.56	≤-40	PASS
				-20	-31.36	≤-25	PASS
Ant2	5500			+20	-30.21	≤-25	PASS
				+40	-52.76	≤-40	PASS
				-40	-52.88	≤-40	PASS
				-20	-31.36	≤-25	PASS
total	5500			+20	-30.26	≤-25	PASS
				+40	-53.08	≤-40	PASS
				-40	-53.96	≤-40	PASS
				-20	-30.85	≤-25	PASS
Ant1	5600			+20	-31.07	≤-25	PASS
				+40	-55.06	≤-40	PASS
				-40	-55.48	≤-40	PASS
				-20	-31.94	≤-25	PASS
Ant2	5600			+20	-33.43	≤-25	PASS
				+40	-57.50	≤-40	PASS
				-40	-55.09	≤-40	PASS
				-20	-31.67	≤-25	PASS
total	5600			+20	-32.78	≤-25	PASS
				+40	-56.82	≤-40	PASS
				-40	-53.19	≤-40	PASS
				-20	-31.67	≤-25	PASS
Ant1	5720			+20	-31.67	≤-25	PASS
				+40	-56.82	≤-40	PASS
				-40	-53.19	≤-40	PASS
				-20	-31.67	≤-25	PASS

11N40MIM O				-20	-30.99	≤-25	PASS
				+20	-31.13	≤-25	PASS
				+40	-53.71	≤-40	PASS
		Ant2	5720	-40	-50.18	≤-40	PASS
				-20	-29.56	≤-25	PASS
				+20	-30.37	≤-25	PASS
		total	5720	+40	-49.56	≤-40	PASS
				-40	-50.57	≤-40	PASS
				-20	-29.77	≤-25	PASS
				+20	-30.49	≤-25	PASS
				+40	-50.05	≤-40	PASS
		Ant1	5190	-80	-54.60	≤-40	PASS
				-40	-37.54	≤-25	PASS
				+40	-38.22	≤-25	PASS
		Ant2	5190	+80	-54.84	≤-40	PASS
				-80	-55.14	≤-40	PASS
				-40	-38.83	≤-25	PASS
		total	5190	+40	-38.99	≤-25	PASS
				+80	-54.53	≤-40	PASS
				-80	-55.03	≤-40	PASS
		Ant1	5230	-40	-38.53	≤-25	PASS
				+40	-38.82	≤-25	PASS
				+80	-54.60	≤-40	PASS
		Ant2	5230	-80	-54.66	≤-40	PASS
				-40	-38.47	≤-25	PASS
				+40	-37.51	≤-25	PASS
		total	5230	+80	-54.00	≤-40	PASS
				-80	-54.43	≤-40	PASS
				-40	-39.82	≤-25	PASS
		Ant1	5270	+40	-37.87	≤-25	PASS
				+80	-53.96	≤-40	PASS
				-80	-54.48	≤-40	PASS
		Ant2	5270	-40	-39.53	≤-25	PASS
				+40	-37.80	≤-25	PASS
				+80	-53.97	≤-40	PASS
		total	5270	-80	-54.85	≤-40	PASS
				-40	-37.84	≤-25	PASS
				+40	-38.41	≤-25	PASS
		Ant1	5310	+80	-53.09	≤-40	PASS
				-80	-55.25	≤-40	PASS
				-40	-39.23	≤-25	PASS
		Ant2	5310	+40	-39.11	≤-25	PASS
				+80	-53.75	≤-40	PASS
				-80	-55.17	≤-40	PASS
		total	5310	-40	-38.93	≤-25	PASS
				+40	-38.97	≤-25	PASS
				+80	-53.61	≤-40	PASS
		Ant1	5510	-80	-54.67	≤-40	PASS
				-40	-38.77	≤-25	PASS
				+40	-37.21	≤-25	PASS
		Ant2	5510	+80	-53.34	≤-40	PASS
				-80	-54.65	≤-40	PASS
				-40	-38.63	≤-25	PASS
		total	5510	+40	-37.45	≤-25	PASS
				+80	-53.52	≤-40	PASS
				-80	-54.66	≤-40	PASS
		Ant1	5510	-40	-38.66	≤-25	PASS
				+40	-37.40	≤-25	PASS
				+80	-53.48	≤-40	PASS
		Ant2	5510	-80	-51.66	≤-40	PASS
				-40	-33.36	≤-25	PASS
				+40	-33.09	≤-25	PASS
		total	5510	+80	-51.18	≤-40	PASS
				-80	-52.45	≤-40	PASS
				-40	-36.23	≤-25	PASS
				+40	-36.80	≤-25	PASS
				+80	-53.64	≤-40	PASS
				-80	-52.23	≤-40	PASS
				-40	-35.27	≤-25	PASS
				+40	-35.48	≤-25	PASS
				+80	-52.85	≤-40	PASS

11AC20MI MO	Ant1	5590	-80	-50.22	≤-40	PASS
			-40	-31.77	≤-25	PASS
			+40	-31.64	≤-25	PASS
			+80	-49.99	≤-40	PASS
		5590	-80	-49.35	≤-40	PASS
			-40	-32.22	≤-25	PASS
			+40	-33.40	≤-25	PASS
			+80	-51.80	≤-40	PASS
		total	-80	-49.52	≤-40	PASS
			-40	-32.12	≤-25	PASS
			+40	-32.96	≤-25	PASS
			+80	-51.35	≤-40	PASS
	Ant2	5710	-80	-50.76	≤-40	PASS
			-40	-32.44	≤-25	PASS
			+40	-32.66	≤-25	PASS
			+80	-50.63	≤-40	PASS
		5710	-80	-51.03	≤-40	PASS
			-40	-33.95	≤-25	PASS
			+40	-34.52	≤-25	PASS
			+80	-50.73	≤-40	PASS
		total	-80	-50.97	≤-40	PASS
			-40	-33.55	≤-25	PASS
			+40	-34.02	≤-25	PASS
			+80	-50.71	≤-40	PASS
	Ant1	5180	-40	-56.03	≤-40	PASS
			-20	-31.81	≤-25	PASS
			+20	-32.33	≤-25	PASS
			+40	-56.54	≤-40	PASS
		5180	-40	-55.97	≤-40	PASS
			-20	-33.34	≤-25	PASS
			+20	-33.05	≤-25	PASS
			+40	-56.21	≤-40	PASS
		total	-40	-55.98	≤-40	PASS
			-20	-32.96	≤-25	PASS
			+20	-32.89	≤-25	PASS
			+40	-56.28	≤-40	PASS
	Ant2	5200	-40	-56.06	≤-40	PASS
			-20	-32.19	≤-25	PASS
			+20	-32.12	≤-25	PASS
			+40	-56.04	≤-40	PASS
		5200	-40	-55.20	≤-40	PASS
			-20	-33.01	≤-25	PASS
			+20	-33.00	≤-25	PASS
			+40	-55.12	≤-40	PASS
		total	-40	-55.37	≤-40	PASS
			-20	-32.83	≤-25	PASS
			+20	-32.80	≤-25	PASS
			+40	-55.30	≤-40	PASS
	Ant1	5240	-40	-56.80	≤-40	PASS
			-20	-32.91	≤-25	PASS
			+20	-31.37	≤-25	PASS
			+40	-55.94	≤-40	PASS
		5240	-40	-56.49	≤-40	PASS
			-20	-33.92	≤-25	PASS
			+20	-32.60	≤-25	PASS
			+40	-55.60	≤-40	PASS
		total	-40	-56.56	≤-40	PASS
			-20	-33.68	≤-25	PASS
			+20	-32.30	≤-25	PASS
			+40	-55.68	≤-40	PASS
	Ant2	5260	-40	-57.98	≤-40	PASS
			-20	-32.90	≤-25	PASS
			+20	-32.46	≤-25	PASS
			+40	-57.46	≤-40	PASS
		5260	-40	-58.41	≤-40	PASS
			-20	-33.63	≤-25	PASS
			+20	-33.13	≤-25	PASS
			+40	-58.15	≤-40	PASS
		total	-40	-58.32	≤-40	PASS
			-20	-33.48	≤-25	PASS
			+20	-32.99	≤-25	PASS

11AC40MI MO		Ant1	5280	+40	-58.00	≤-40	PASS
				-40	-56.89	≤-40	PASS
				-20	-32.24	≤-25	PASS
				+20	-32.50	≤-25	PASS
		Ant2	5280	+40	-56.53	≤-40	PASS
				-40	-56.53	≤-40	PASS
				-20	-32.88	≤-25	PASS
				+20	-33.34	≤-25	PASS
		total	5280	+40	-56.25	≤-40	PASS
				-40	-56.60	≤-40	PASS
				-20	-32.74	≤-25	PASS
				+20	-33.15	≤-25	PASS
		Ant1	5320	+40	-56.30	≤-40	PASS
				-40	-56.54	≤-40	PASS
				-20	-33.76	≤-25	PASS
				+20	-32.28	≤-25	PASS
		Ant2	5320	+40	-55.21	≤-40	PASS
				-40	-57.02	≤-40	PASS
				-20	-32.90	≤-25	PASS
				+20	-31.92	≤-25	PASS
		total	5320	+40	-55.47	≤-40	PASS
				-40	-56.92	≤-40	PASS
				-20	-33.06	≤-25	PASS
				+20	-31.99	≤-25	PASS
		Ant1	5500	+40	-55.41	≤-40	PASS
				-40	-52.62	≤-40	PASS
				-20	-30.73	≤-25	PASS
				+20	-30.44	≤-25	PASS
		Ant2	5500	+40	-52.56	≤-40	PASS
				-40	-53.48	≤-40	PASS
				-20	-32.08	≤-25	PASS
				+20	-31.34	≤-25	PASS
		total	5500	+40	-53.69	≤-40	PASS
				-40	-53.26	≤-40	PASS
				-20	-31.72	≤-25	PASS
				+20	-31.11	≤-25	PASS
		Ant1	5600	+40	-53.39	≤-40	PASS
				-40	-51.82	≤-40	PASS
				-20	-29.44	≤-25	PASS
				+20	-30.90	≤-25	PASS
		Ant2	5600	+40	-53.42	≤-40	PASS
				-40	-53.19	≤-40	PASS
				-20	-30.46	≤-25	PASS
				+20	-31.83	≤-25	PASS
		total	5600	+40	-55.48	≤-40	PASS
				-40	-52.82	≤-40	PASS
				-20	-30.19	≤-25	PASS
				+20	-31.59	≤-25	PASS
		Ant1	5720	+40	-54.89	≤-40	PASS
				-40	-52.16	≤-40	PASS
				-20	-30.68	≤-25	PASS
				+20	-30.75	≤-25	PASS
		Ant2	5720	+40	-52.93	≤-40	PASS
				-40	-50.82	≤-40	PASS
				-20	-30.81	≤-25	PASS
				+20	-31.01	≤-25	PASS
		total	5720	+40	-51.01	≤-40	PASS
				-40	-51.07	≤-40	PASS
				-20	-30.79	≤-25	PASS
				+20	-30.96	≤-25	PASS
11AC40MI MO		Ant1	5190	+40	-51.34	≤-40	PASS
				-80	-53.64	≤-40	PASS
				-40	-37.14	≤-25	PASS
				+40	-38.70	≤-25	PASS
		Ant2	5190	+80	-53.29	≤-40	PASS
				-80	-54.35	≤-40	PASS
				-40	-38.54	≤-25	PASS
				+40	-39.31	≤-25	PASS
		total	5190	+80	-53.65	≤-40	PASS
				-80	-54.20	≤-40	PASS
				-40	-38.23	≤-25	PASS
				+40	-38.23	≤-25	PASS

			+40	-39.18	≤-25	PASS
			+80	-53.58	≤-40	PASS
			-80	-53.39	≤-40	PASS
	Ant1	5230	-40	-39.24	≤-25	PASS
			+40	-37.51	≤-25	PASS
			+80	-52.70	≤-40	PASS
			-80	-53.66	≤-40	PASS
	Ant2	5230	-40	-39.05	≤-25	PASS
			+40	-37.68	≤-25	PASS
			+80	-52.98	≤-40	PASS
			-80	-53.60	≤-40	PASS
	total	5230	-40	-39.08	≤-25	PASS
			+40	-37.64	≤-25	PASS
			+80	-52.92	≤-40	PASS
			-80	-54.09	≤-40	PASS
	Ant1	5270	-40	-38.20	≤-25	PASS
			+40	-38.44	≤-25	PASS
			+80	-51.97	≤-40	PASS
			-80	-54.00	≤-40	PASS
	Ant2	5270	-40	-39.12	≤-25	PASS
			+40	-39.28	≤-25	PASS
			+80	-52.29	≤-40	PASS
			-80	-54.02	≤-40	PASS
	total	5270	-40	-38.93	≤-25	PASS
			+40	-39.11	≤-25	PASS
			+80	-52.23	≤-40	PASS
			-80	-54.44	≤-40	PASS
	Ant1	5310	-40	-38.86	≤-25	PASS
			+40	-37.21	≤-25	PASS
			+80	-52.82	≤-40	PASS
			-80	-54.49	≤-40	PASS
	Ant2	5310	-40	-39.01	≤-25	PASS
			+40	-37.59	≤-25	PASS
			+80	-53.27	≤-40	PASS
			-80	-54.48	≤-40	PASS
	total	5310	-40	-38.97	≤-25	PASS
			+40	-37.49	≤-25	PASS
			+80	-53.16	≤-40	PASS
			-80	-49.05	≤-40	PASS
	Ant1	5510	-40	-30.51	≤-25	PASS
			+40	-30.17	≤-25	PASS
			+80	-48.56	≤-40	PASS
			-80	-48.95	≤-40	PASS
	Ant2	5510	-40	-31.55	≤-25	PASS
			+40	-32.00	≤-25	PASS
			+80	-50.47	≤-40	PASS
			-80	-48.98	≤-40	PASS
	total	5510	-40	-31.30	≤-25	PASS
			+40	-31.52	≤-25	PASS
			+80	-49.96	≤-40	PASS
			-80	-49.92	≤-40	PASS
	Ant1	5590	-40	-31.38	≤-25	PASS
			+40	-31.69	≤-25	PASS
			+80	-50.39	≤-40	PASS
			-80	-47.09	≤-40	PASS
	Ant2	5590	-40	-30.00	≤-25	PASS
			+40	-30.22	≤-25	PASS
			+80	-49.89	≤-40	PASS
			-80	-47.27	≤-40	PASS
	total	5590	-40	-29.87	≤-25	PASS
			+40	-30.08	≤-25	PASS
			+80	-49.41	≤-40	PASS
			-80	-48.46	≤-40	PASS
	Ant1	5710	-40	-29.24	≤-25	PASS
			+40	-30.00	≤-25	PASS
			+80	-48.20	≤-40	PASS
			-80	-46.66	≤-40	PASS
	Ant2	5710	-40	-28.51	≤-25	PASS
			+40	-29.22	≤-25	PASS
			+80	-46.36	≤-40	PASS
	total	5710	-80	-46.97	≤-40	PASS

				-40	-28.65	≤-25	PASS
				+40	-29.37	≤-25	PASS
				+80	-46.68	≤-40	PASS
				+80	-37.27	≤-25	PASS
11AC80MI MO	Ant1	5210		-80	-38.77	≤-25	PASS
				+80	-37.27	≤-25	PASS
	Ant2	5210		-80	-38.51	≤-25	PASS
				+80	-38.03	≤-25	PASS
	total	5210		-80	-38.66	≤-25	PASS
				+80	-38.07	≤-25	PASS
	Ant1	5290		-80	-38.57	≤-25	PASS
				+80	-37.08	≤-25	PASS
	Ant2	5290		-80	-38.99	≤-25	PASS
				+80	-37.87	≤-25	PASS
	total	5290		-80	-38.91	≤-25	PASS
				+80	-37.71	≤-25	PASS
	Ant1	5530		-80	-32.08	≤-25	PASS
				+80	-32.06	≤-25	PASS
	Ant2	5530		-80	-31.38	≤-25	PASS
				+80	-33.17	≤-25	PASS
	total	5530		-80	-31.51	≤-25	PASS
				+80	-32.92	≤-25	PASS
	Ant1	5610		-80	-30.09	≤-25	PASS
				+80	-31.02	≤-25	PASS
	Ant2	5610		-80	-31.59	≤-25	PASS
				+80	-34.48	≤-25	PASS
	total	5610		-80	-31.19	≤-25	PASS
				+80	-33.40	≤-25	PASS
	Ant1	5690		-80	-30.99	≤-25	PASS
				+80	-31.62	≤-25	PASS
	Ant2	5690		-80	-30.76	≤-25	PASS
				+80	-31.78	≤-25	PASS
	total	5690		-80	-30.81	≤-25	PASS
				+80	-31.75	≤-25	PASS
11AX20MI MO	Ant1	5180		-40	-51.21	≤-40	PASS
				-20	-30.68	≤-25	PASS
				+20	-29.90	≤-25	PASS
				+40	-49.77	≤-40	PASS
	Ant2	5180		-40	-50.96	≤-40	PASS
				-20	-29.72	≤-25	PASS
				+20	-30.04	≤-25	PASS
				+40	-50.20	≤-40	PASS
	total	5180		-40	-50.98	≤-40	PASS
				-20	-29.80	≤-25	PASS
				+20	-30.02	≤-25	PASS
				+40	-50.15	≤-40	PASS
	Ant1	5200		-40	-58.92	≤-40	PASS
				-20	-30.41	≤-25	PASS
				+20	-30.10	≤-25	PASS
				+40	-59.06	≤-40	PASS
	Ant2	5200		-40	-57.18	≤-40	PASS
				-20	-29.63	≤-25	PASS
				+20	-30.74	≤-25	PASS
				+40	-57.87	≤-40	PASS
	total	5200		-40	-57.68	≤-40	PASS
				-20	-29.87	≤-25	PASS
				+20	-30.52	≤-25	PASS
				+40	-58.23	≤-40	PASS
	Ant1	5240		-40	-59.94	≤-40	PASS
				-20	-30.93	≤-25	PASS
				+20	-29.25	≤-25	PASS
				+40	-59.72	≤-40	PASS
	Ant2	5240		-40	-58.36	≤-40	PASS
				-20	-30.70	≤-25	PASS
				+20	-30.33	≤-25	PASS
				+40	-59.29	≤-40	PASS
	total	5240		-40	-58.69	≤-40	PASS
				-20	-30.75	≤-25	PASS
				+20	-30.05	≤-25	PASS
				+40	-59.39	≤-40	PASS
	Ant1	5260		-40	-59.74	≤-40	PASS
				-20	-29.99	≤-25	PASS

				+20	-30.11	≤-25	PASS
				+40	-59.69	≤-40	PASS
				-40	-58.74	≤-40	PASS
				-20	-31.20	≤-25	PASS
Ant2	5260			+20	-30.37	≤-25	PASS
				+40	-59.96	≤-40	PASS
				-40	-58.92	≤-40	PASS
				-20	-30.93	≤-25	PASS
total	5260			+20	-30.31	≤-25	PASS
				+40	-59.90	≤-40	PASS
				-40	-59.11	≤-40	PASS
				-20	-30.16	≤-25	PASS
Ant1	5280			+20	-29.95	≤-25	PASS
				+40	-59.20	≤-40	PASS
				-40	-59.57	≤-40	PASS
				-20	-30.77	≤-25	PASS
Ant2	5280			+20	-30.58	≤-25	PASS
				+40	-60.56	≤-40	PASS
				-40	-59.50	≤-40	PASS
				-20	-30.68	≤-25	PASS
total	5280			+20	-30.48	≤-25	PASS
				+40	-60.34	≤-40	PASS
				-40	-59.07	≤-40	PASS
				-20	-30.08	≤-25	PASS
Ant1	5320			+20	-28.55	≤-25	PASS
				+40	-58.06	≤-40	PASS
				-40	-58.15	≤-40	PASS
				-20	-31.05	≤-25	PASS
Ant2	5320			+20	-30.45	≤-25	PASS
				+40	-58.39	≤-40	PASS
				-40	-58.28	≤-40	PASS
				-20	-30.90	≤-25	PASS
total	5320			+20	-30.12	≤-25	PASS
				+40	-58.34	≤-40	PASS
				-40	-52.78	≤-40	PASS
				-20	-29.39	≤-25	PASS
Ant1	5500			+20	-28.22	≤-25	PASS
				+40	-51.89	≤-40	PASS
				-40	-52.51	≤-40	PASS
				-20	-29.35	≤-25	PASS
Ant2	5500			+20	-29.39	≤-25	PASS
				+40	-52.11	≤-40	PASS
				-40	-52.57	≤-40	PASS
				-20	-29.36	≤-25	PASS
total	5500			+20	-29.13	≤-25	PASS
				+40	-52.07	≤-40	PASS
				-40	-54.61	≤-40	PASS
				-20	-29.01	≤-25	PASS
Ant1	5600			+20	-29.65	≤-25	PASS
				+40	-55.99	≤-40	PASS
				-40	-49.14	≤-40	PASS
				-20	-27.99	≤-25	PASS
Ant2	5600			+20	-27.84	≤-25	PASS
				+40	-50.05	≤-40	PASS
				-40	-49.57	≤-40	PASS
				-20	-28.11	≤-25	PASS
total	5600			+20	-28.04	≤-25	PASS
				+40	-50.50	≤-40	PASS
				-40	-45.58	≤-40	PASS
				-20	-26.62	≤-25	PASS
Ant1	5720			+20	-26.14	≤-25	PASS
				+40	-45.87	≤-40	PASS
				-40	-44.91	≤-40	PASS
				-20	-25.79	≤-25	PASS
Ant2	5720			+20	-25.84	≤-25	PASS
				+40	-45.26	≤-40	PASS
				-40	-45.02	≤-40	PASS
				-20	-25.92	≤-25	PASS
total	5720			+20	-25.89	≤-25	PASS
				+40	-45.36	≤-40	PASS
				-80	-54.93	≤-40	PASS
11AX40MI	Ant1	5190					

MO				-40	-35.82	≤-25	PASS
				+40	-35.96	≤-25	PASS
				+80	-54.53	≤-40	PASS
				-80	-55.01	≤-40	PASS
				-40	-35.89	≤-25	PASS
				+40	-35.99	≤-25	PASS
				+80	-54.48	≤-40	PASS
				-80	-54.99	≤-40	PASS
				-40	-35.87	≤-25	PASS
				+40	-35.98	≤-25	PASS
				+80	-54.49	≤-40	PASS
				-80	-55.07	≤-40	PASS
				-40	-36.58	≤-25	PASS
				+40	-35.31	≤-25	PASS
				+80	-55.45	≤-40	PASS
				-80	-54.39	≤-40	PASS
				-40	-36.33	≤-25	PASS
				+40	-35.13	≤-25	PASS
				+80	-54.72	≤-40	PASS
				-80	-54.53	≤-40	PASS
				-40	-36.39	≤-25	PASS
				+40	-35.17	≤-25	PASS
				+80	-54.87	≤-40	PASS
				-80	-55.15	≤-40	PASS
				-40	-37.05	≤-25	PASS
				+40	-35.18	≤-25	PASS
				+80	-53.75	≤-40	PASS
				-80	-55.64	≤-40	PASS
				-40	-36.24	≤-25	PASS
				+40	-35.69	≤-25	PASS
				+80	-54.30	≤-40	PASS
				-80	-55.54	≤-40	PASS
				-40	-36.39	≤-25	PASS
				+40	-35.59	≤-25	PASS
				+80	-54.19	≤-40	PASS
				-80	-55.24	≤-40	PASS
				-40	-36.33	≤-25	PASS
				+40	-34.33	≤-25	PASS
				+80	-54.27	≤-40	PASS
				-80	-54.87	≤-40	PASS
				-40	-35.29	≤-25	PASS
				+40	-34.54	≤-25	PASS
				+80	-53.79	≤-40	PASS
				-80	-54.96	≤-40	PASS
				-40	-35.52	≤-25	PASS
				+40	-34.49	≤-25	PASS
				+80	-53.90	≤-40	PASS
				-80	-54.31	≤-40	PASS
				-40	-32.88	≤-25	PASS
				+40	-32.08	≤-25	PASS
				+80	-53.64	≤-40	PASS
				-80	-54.70	≤-40	PASS
				-40	-34.05	≤-25	PASS
				+40	-32.12	≤-25	PASS
				+80	-54.45	≤-40	PASS
				-80	-54.61	≤-40	PASS
				-40	-33.76	≤-25	PASS
				+40	-32.11	≤-25	PASS
				+80	-54.26	≤-40	PASS
				-80	-53.43	≤-40	PASS
				-40	-32.37	≤-25	PASS
				+40	-31.73	≤-25	PASS
				+80	-53.25	≤-40	PASS
				-80	-49.18	≤-40	PASS
				-40	-29.74	≤-25	PASS
				+40	-30.15	≤-25	PASS
				+80	-49.40	≤-40	PASS
				-80	-49.61	≤-40	PASS
				-40	-30.05	≤-25	PASS
				+40	-30.35	≤-25	PASS
				+80	-49.80	≤-40	PASS

11AX80MI MO	Ant1	5710	-80	-49.49	≤-40	PASS
			-40	-30.01	≤-25	PASS
			+40	-30.23	≤-25	PASS
			+80	-50.01	≤-40	PASS
	Ant2	5710	-80	-50.64	≤-40	PASS
			-40	-30.55	≤-25	PASS
			+40	-31.02	≤-25	PASS
			+80	-51.10	≤-40	PASS
	total	5710	-80	-50.38	≤-40	PASS
			-40	-30.43	≤-25	PASS
			+40	-30.84	≤-25	PASS
			+80	-50.85	≤-40	PASS
	Ant1	5210	-80	-37.56	≤-25	PASS
			+80	-35.61	≤-25	PASS
	Ant2	5210	-80	-36.70	≤-25	PASS
			+80	-35.65	≤-25	PASS
	total	5210	-80	-36.86	≤-25	PASS
			+80	-35.64	≤-25	PASS
	Ant1	5290	-80	-36.99	≤-25	PASS
			+80	-35.35	≤-25	PASS
	Ant2	5290	-80	-36.27	≤-25	PASS
			+80	-35.62	≤-25	PASS
	total	5290	-80	-36.43	≤-25	PASS
			+80	-35.56	≤-25	PASS
	Ant1	5530	-80	-33.59	≤-25	PASS
			+80	-34.28	≤-25	PASS
	Ant2	5530	-80	-33.50	≤-25	PASS
			+80	-34.29	≤-25	PASS
	total	5530	-80	-33.52	≤-25	PASS
			+80	-34.29	≤-25	PASS
	Ant1	5610	-80	-33.31	≤-25	PASS
			+80	-34.71	≤-25	PASS
	Ant2	5610	-80	-34.37	≤-25	PASS
			+80	-35.14	≤-25	PASS
	total	5610	-80	-34.12	≤-25	PASS
			+80	-35.04	≤-25	PASS
	Ant1	5690	-80	-34.03	≤-25	PASS
			+80	-34.83	≤-25	PASS
	Ant2	5690	-80	-33.46	≤-25	PASS
			+80	-35.02	≤-25	PASS
	total	5690	-80	-33.58	≤-25	PASS
			+80	-34.98	≤-25	PASS
11BE20MI MO	Ant1	5180	-40	-52.87	≤-40	PASS
			-20	-29.81	≤-25	PASS
			+20	-30.51	≤-25	PASS
			+40	-53.39	≤-40	PASS
	Ant2	5180	-40	-57.53	≤-40	PASS
			-20	-30.73	≤-25	PASS
			+20	-30.47	≤-25	PASS
			+40	-58.49	≤-40	PASS
	total	5180	-40	-56.72	≤-40	PASS
			-20	-30.62	≤-25	PASS
			+20	-30.47	≤-25	PASS
			+40	-57.56	≤-40	PASS
	Ant1	5200	-40	-56.25	≤-40	PASS
			-20	-30.28	≤-25	PASS
			+20	-29.59	≤-25	PASS
			+40	-56.16	≤-40	PASS
	Ant2	5200	-40	-57.14	≤-40	PASS
			-20	-30.43	≤-25	PASS
			+20	-30.90	≤-25	PASS
			+40	-57.18	≤-40	PASS
	total	5200	-40	-56.96	≤-40	PASS
			-20	-30.40	≤-25	PASS
			+20	-30.63	≤-25	PASS
			+40	-56.98	≤-40	PASS
	Ant1	5240	-40	-58.92	≤-40	PASS
			-20	-30.74	≤-25	PASS
			+20	-29.09	≤-25	PASS
			+40	-57.53	≤-40	PASS
	Ant2	5240	-40	-59.14	≤-40	PASS

			-20	-31.18	≤-25	PASS
			+20	-29.78	≤-25	PASS
			+40	-58.43	≤-40	PASS
total	5240		-40	-59.09	≤-40	PASS
			-20	-31.08	≤-25	PASS
			+20	-29.62	≤-25	PASS
			+40	-58.21	≤-40	PASS
Ant1	5260		-40	-57.58	≤-40	PASS
			-20	-30.40	≤-25	PASS
			+20	-30.26	≤-25	PASS
			+40	-57.47	≤-40	PASS
Ant2	5260		-40	-59.11	≤-40	PASS
			-20	-31.96	≤-25	PASS
			+20	-30.72	≤-25	PASS
			+40	-58.98	≤-40	PASS
total	5260		-40	-58.78	≤-40	PASS
			-20	-31.62	≤-25	PASS
			+20	-30.63	≤-25	PASS
			+40	-58.66	≤-40	PASS
Ant1	5280		-40	-57.82	≤-40	PASS
			-20	-30.33	≤-25	PASS
			+20	-29.97	≤-25	PASS
			+40	-57.19	≤-40	PASS
Ant2	5280		-40	-58.04	≤-40	PASS
			-20	-30.53	≤-25	PASS
			+20	-31.30	≤-25	PASS
			+40	-58.13	≤-40	PASS
total	5280		-40	-57.99	≤-40	PASS
			-20	-30.49	≤-25	PASS
			+20	-30.98	≤-25	PASS
			+40	-57.91	≤-40	PASS
Ant1	5320		-40	-57.53	≤-40	PASS
			-20	-30.36	≤-25	PASS
			+20	-29.30	≤-25	PASS
			+40	-55.45	≤-40	PASS
Ant2	5320		-40	-57.59	≤-40	PASS
			-20	-31.63	≤-25	PASS
			+20	-30.08	≤-25	PASS
			+40	-56.44	≤-40	PASS
total	5320		-40	-57.58	≤-40	PASS
			-20	-31.33	≤-25	PASS
			+20	-29.90	≤-25	PASS
			+40	-56.21	≤-40	PASS
Ant1	5500		-40	-50.37	≤-40	PASS
			-20	-27.80	≤-25	PASS
			+20	-27.60	≤-25	PASS
			+40	-50.36	≤-40	PASS
Ant2	5500		-40	-49.15	≤-40	PASS
			-20	-27.98	≤-25	PASS
			+20	-27.29	≤-25	PASS
			+40	-48.68	≤-40	PASS
total	5500		-40	-49.37	≤-40	PASS
			-20	-27.94	≤-25	PASS
			+20	-27.35	≤-25	PASS
			+40	-48.97	≤-40	PASS
Ant1	5600		-40	-46.84	≤-40	PASS
			-20	-26.06	≤-25	PASS
			+20	-26.74	≤-25	PASS
			+40	-48.32	≤-40	PASS
Ant2	5600		-40	-49.74	≤-40	PASS
			-20	-27.09	≤-25	PASS
			+20	-29.32	≤-25	PASS
			+40	-52.09	≤-40	PASS
total	5600		-40	-48.65	≤-40	PASS
			-20	-26.75	≤-25	PASS
			+20	-28.37	≤-25	PASS
			+40	-50.58	≤-40	PASS
Ant1	5720		-40	-47.82	≤-40	PASS
			-20	-26.74	≤-25	PASS
			+20	-26.92	≤-25	PASS
			+40	-47.98	≤-40	PASS

11BE40MI MO	Ant2	5720	-40	-51.82	≤-40	PASS
			-20	-29.72	≤-25	PASS
			+20	-28.23	≤-25	PASS
			+40	-51.09	≤-40	PASS
		total	-40	-50.22	≤-40	PASS
			-20	-28.61	≤-25	PASS
			+20	-27.80	≤-25	PASS
			+40	-49.92	≤-40	PASS
			-80	-54.92	≤-40	PASS
			-40	-35.15	≤-25	PASS
	Ant1	5190	+40	-35.28	≤-25	PASS
			+80	-54.36	≤-40	PASS
			-80	-55.57	≤-40	PASS
			-40	-36.38	≤-25	PASS
		5190	+40	-36.71	≤-25	PASS
			+80	-54.83	≤-40	PASS
			-80	-55.44	≤-40	PASS
			-40	-36.12	≤-25	PASS
		total	+40	-36.40	≤-25	PASS
			+80	-54.74	≤-40	PASS
	Ant1	5230	-80	-54.98	≤-40	PASS
			-40	-36.07	≤-25	PASS
			+40	-34.78	≤-25	PASS
			+80	-54.33	≤-40	PASS
		5230	-80	-54.73	≤-40	PASS
			-40	-36.57	≤-25	PASS
			+40	-35.21	≤-25	PASS
			+80	-54.24	≤-40	PASS
		total	-80	-54.78	≤-40	PASS
			-40	-36.46	≤-25	PASS
			+40	-35.12	≤-25	PASS
			+80	-54.26	≤-40	PASS
	Ant1	5270	-80	-55.54	≤-40	PASS
			-40	-35.93	≤-25	PASS
			+40	-36.26	≤-25	PASS
			+80	-53.85	≤-40	PASS
		5270	-80	-54.92	≤-40	PASS
			-40	-36.55	≤-25	PASS
			+40	-36.58	≤-25	PASS
			+80	-53.49	≤-40	PASS
		total	-80	-55.04	≤-40	PASS
			-40	-36.42	≤-25	PASS
			+40	-36.52	≤-25	PASS
			+80	-53.56	≤-40	PASS
	Ant1	5310	-80	-54.82	≤-40	PASS
			-40	-35.56	≤-25	PASS
			+40	-33.80	≤-25	PASS
			+80	-53.08	≤-40	PASS
		5310	-80	-54.15	≤-40	PASS
			-40	-35.85	≤-25	PASS
			+40	-35.32	≤-25	PASS
			+80	-53.05	≤-40	PASS
		total	-80	-54.29	≤-40	PASS
			-40	-35.78	≤-25	PASS
			+40	-34.91	≤-25	PASS
			+80	-53.05	≤-40	PASS
	Ant1	5510	-80	-50.62	≤-40	PASS
			-40	-31.53	≤-25	PASS
			+40	-32.05	≤-25	PASS
			+80	-50.22	≤-40	PASS
		5510	-80	-52.23	≤-40	PASS
			-40	-33.51	≤-25	PASS
			+40	-33.49	≤-25	PASS
			+80	-52.71	≤-40	PASS
		total	-80	-51.71	≤-40	PASS
			-40	-32.85	≤-25	PASS
			+40	-33.03	≤-25	PASS
			+80	-51.85	≤-40	PASS
	Ant1	5590	-80	-49.43	≤-40	PASS
			-40	-30.59	≤-25	PASS
			+40	-31.15	≤-25	PASS

		Ant2	5590	+80	-49.90	≤-40	PASS
				-80	-50.11	≤-40	PASS
				-40	-32.37	≤-25	PASS
				+40	-34.14	≤-25	PASS
		total	5590	+80	-53.16	≤-40	PASS
				-80	-49.91	≤-40	PASS
				-40	-31.80	≤-25	PASS
				+40	-33.08	≤-25	PASS
		Ant1	5710	+80	-51.98	≤-40	PASS
				-80	-48.98	≤-40	PASS
				-40	-30.30	≤-25	PASS
				+40	-31.45	≤-25	PASS
		Ant2	5710	+80	-49.97	≤-40	PASS
				-80	-49.14	≤-40	PASS
				-40	-31.16	≤-25	PASS
				+40	-33.56	≤-25	PASS
		total	5710	+80	-50.40	≤-40	PASS
				-80	-49.10	≤-40	PASS
				-40	-30.93	≤-25	PASS
				+40	-32.94	≤-25	PASS
	11BE80MI MO	Ant1	5210	+80	-50.29	≤-40	PASS
				-80	-35.91	≤-25	PASS
		Ant2	5210	+80	-35.03	≤-25	PASS
				-80	-37.12	≤-25	PASS
		total	5210	+80	-36.01	≤-25	PASS
				-80	-36.87	≤-25	PASS
		Ant1	5290	+80	-35.81	≤-25	PASS
				-80	-36.61	≤-25	PASS
		Ant2	5290	+80	-35.10	≤-25	PASS
				-80	-36.93	≤-25	PASS
		total	5290	+80	-36.08	≤-25	PASS
				-80	-36.86	≤-25	PASS
		Ant1	5530	+80	-35.86	≤-25	PASS
				-80	-32.48	≤-25	PASS
		Ant2	5530	+80	-33.51	≤-25	PASS
				-80	-34.89	≤-25	PASS
		total	5530	+80	-35.52	≤-25	PASS
				-80	-34.14	≤-25	PASS
		Ant1	5610	+80	-34.91	≤-25	PASS
				-80	-31.93	≤-25	PASS
		Ant2	5610	+80	-33.55	≤-25	PASS
				-80	-32.79	≤-25	PASS
		total	5610	+80	-35.63	≤-25	PASS
				-80	-32.58	≤-25	PASS
		Ant1	5690	+80	-35.06	≤-25	PASS
				-80	-32.75	≤-25	PASS
		Ant2	5690	+80	-33.71	≤-25	PASS
				-80	-29.04	≤-25	PASS
		total	5690	+80	-30.87	≤-25	PASS
				-80	-29.50	≤-25	PASS
				+80	-31.25	≤-25	PASS
				-80	-31.25	≤-25	PASS

4.2 Test Graphs

Please refer to recording the spectrum plots in the worst conditions.

