

Appendix E_5.6G WIFI

Antenna Power


Condition	Mode	Frequency (MHz)	Antenna	Power (dBm/MHz)	Power (mW/MHz)	Limit (mW/MHz)	Declared Power (mW/MHz)	Tolerance (%)	Lower Limit (%)	Upper Limit (%)	Verdict
NVNT	a	5500	Ant1	5.26	3.357	10	5	-32.85	-50	50	Pass
NVNT	a	5580	Ant1	4.95	3.126	10	5	-37.48	-50	50	Pass
NVNT	a	5720	Ant1	4.86	3.062	10	5	-38.76	-50	50	Pass
NVNT	a	5500	Ant2	6.91	4.909	10	5	-1.82	-50	50	Pass
NVNT	a	5580	Ant2	6.43	4.395	10	5	-12.09	-50	50	Pass
NVNT	a	5720	Ant2	6.06	4.036	10	5	-19.27	-50	50	Pass
NVNT	a	5500	Ant3	6.8	4.786	10	5	-4.27	-50	50	Pass
NVNT	a	5580	Ant3	6.49	4.457	10	5	-10.87	-50	50	Pass
NVNT	a	5720	Ant3	6.19	4.159	10	5	-16.82	-50	50	Pass
NVNT	ac20	5500	Ant1	1.84	1.528	10	-	-	-	-	Pass
NVNT	ac20	5500	Ant2	2.82	1.914	10	-	-	-	-	Pass
NVNT	ac20	5500	Ant3	2.98	1.986	10	-	-	-	-	Pass
NVNT	ac20	5500	Sum	7.35	5.428	10	5	8.56	-50	50	Pass
NVNT	ac20	5580	Ant1	1.32	1.355	10	-	-	-	-	Pass
NVNT	ac20	5580	Ant2	2.76	1.888	10	-	-	-	-	Pass
NVNT	ac20	5580	Ant3	2.97	1.982	10	-	-	-	-	Pass
NVNT	ac20	5580	Sum	7.18	5.225	10	5	4.5	-50	50	Pass
NVNT	ac20	5720	Ant1	2.86	1.932	10	-	-	-	-	Pass
NVNT	ac20	5720	Ant2	2.05	1.603	10	-	-	-	-	Pass
NVNT	ac20	5720	Ant3	2.38	1.73	10	-	-	-	-	Pass
NVNT	ac20	5720	Sum	7.21	5.265	10	5	5.3	-50	50	Pass
NVNT	ac40	5510	Ant1	-1.22	0.755	5	-	-	-	-	Pass
NVNT	ac40	5510	Ant2	0.08	1.019	5	-	-	-	-	Pass
NVNT	ac40	5510	Ant3	0.45	1.109	5	-	-	-	-	Pass
NVNT	ac40	5510	Sum	4.6	2.883	5	2	44.15	-50	50	Pass
NVNT	ac40	5590	Ant1	-0.49	0.893	5	-	-	-	-	Pass
NVNT	ac40	5590	Ant2	0.55	1.135	5	-	-	-	-	Pass
NVNT	ac40	5590	Ant3	-0.18	0.959	5	-	-	-	-	Pass
NVNT	ac40	5590	Sum	4.75	2.987	5	2	49.35	-50	50	Pass
NVNT	ac40	5710	Ant1	0.3	1.072	5	-	-	-	-	Pass

NVNT	ac40	5710	Ant2	-0.41	0.91	5	-	-	-	-	Pass
NVNT	ac40	5710	Ant3	-0.53	0.885	5	-	-	-	-	Pass
NVNT	ac40	5710	Sum	4.57	2.867	5	2	43.35	-50	50	Pass
NVNT	ac80	5530	Ant1	-4.27	0.374	2.5	-	-	-	-	Pass
NVNT	ac80	5530	Ant2	-3.73	0.424	2.5	-	-	-	-	Pass
NVNT	ac80	5530	Ant3	-4.04	0.394	2.5	-	-	-	-	Pass
NVNT	ac80	5530	Sum	0.76	1.192	2.5	1	19.2	-50	50	Pass
NVNT	ac80	5610	Ant1	-3.23	0.475	2.5	-	-	-	-	Pass
NVNT	ac80	5610	Ant2	-3.24	0.474	2.5	-	-	-	-	Pass
NVNT	ac80	5610	Ant3	-3.37	0.46	2.5	-	-	-	-	Pass
NVNT	ac80	5610	Sum	1.49	1.409	2.5	1	40.9	-50	50	Pass
NVNT	ac80	5690	Ant1	-3.31	0.467	2.5	-	-	-	-	Pass
NVNT	ac80	5690	Ant2	-3.26	0.472	2.5	-	-	-	-	Pass
NVNT	ac80	5690	Ant3	-5.77	0.265	2.5	-	-	-	-	Pass
NVNT	ac80	5690	Sum	0.81	1.204	2.5	1	20.4	-50	50	Pass
NVNT	ax20	5500	Ant1	1.28	1.343	10	-	-	-	-	Pass
NVNT	ax20	5500	Ant2	2.48	1.77	10	-	-	-	-	Pass
NVNT	ax20	5500	Ant3	2.07	1.611	10	-	-	-	-	Pass
NVNT	ax20	5500	Sum	6.74	4.724	10	5	-5.52	-50	50	Pass
NVNT	ax20	5580	Ant1	1.51	1.416	10	-	-	-	-	Pass
NVNT	ax20	5580	Ant2	2.05	1.603	10	-	-	-	-	Pass
NVNT	ax20	5580	Ant3	2.59	1.816	10	-	-	-	-	Pass
NVNT	ax20	5580	Sum	6.84	4.835	10	5	-3.3	-50	50	Pass
NVNT	ax20	5720	Ant1	1.8	1.514	10	-	-	-	-	Pass
NVNT	ax20	5720	Ant2	2.36	1.722	10	-	-	-	-	Pass
NVNT	ax20	5720	Ant3	2.03	1.596	10	-	-	-	-	Pass
NVNT	ax20	5720	Sum	6.84	4.832	10	5	-3.36	-50	50	Pass
NVNT	ax40	5510	Ant1	-2.03	0.627	5	-	-	-	-	Pass
NVNT	ax40	5510	Ant2	0.1	1.023	5	-	-	-	-	Pass
NVNT	ax40	5510	Ant3	0.42	1.102	5	-	-	-	-	Pass
NVNT	ax40	5510	Sum	4.4	2.752	5	2	37.6	-50	50	Pass
NVNT	ax40	5590	Ant1	-1.24	0.752	5	-	-	-	-	Pass
NVNT	ax40	5590	Ant2	0.54	1.132	5	-	-	-	-	Pass
NVNT	ax40	5590	Ant3	-0.71	0.849	5	-	-	-	-	Pass
NVNT	ax40	5590	Sum	4.37	2.733	5	2	36.65	-50	50	Pass
NVNT	ax40	5710	Ant1	-0.05	0.989	5	-	-	-	-	Pass
NVNT	ax40	5710	Ant2	-0.57	0.877	5	-	-	-	-	Pass
NVNT	ax40	5710	Ant3	-1.16	0.766	5	-	-	-	-	Pass
NVNT	ax40	5710	Sum	4.2	2.632	5	2	31.6	-50	50	Pass
NVNT	ax80	5530	Ant1	-4.92	0.322	2.5	-	-	-	-	Pass
NVNT	ax80	5530	Ant2	-3.73	0.424	2.5	-	-	-	-	Pass
NVNT	ax80	5530	Ant3	-3.35	0.462	2.5	-	-	-	-	Pass


NVNT	ax80	5530	Sum	0.82	1.208	2.5	1	20.8	-50	50	Pass
NVNT	ax80	5610	Ant1	-3.33	0.465	2.5	-	-	-	-	Pass
NVNT	ax80	5610	Ant2	-3.83	0.414	2.5	-	-	-	-	Pass
NVNT	ax80	5610	Ant3	-2.74	0.532	2.5	-	-	-	-	Pass
NVNT	ax80	5610	Sum	1.5	1.411	2.5	1	41.1	-50	50	Pass
NVNT	ax80	5690	Ant1	-3.1	0.49	2.5	-	-	-	-	Pass
NVNT	ax80	5690	Ant2	-3.51	0.446	2.5	-	-	-	-	Pass
NVNT	ax80	5690	Ant3	-3.6	0.437	2.5	-	-	-	-	Pass
NVNT	ax80	5690	Sum	1.38	1.373	2.5	1	37.3	-50	50	Pass
NVNT	n20	5500	Ant1	1.03	1.268	10	-	-	-	-	Pass
NVNT	n20	5500	Ant2	2.33	1.71	10	-	-	-	-	Pass
NVNT	n20	5500	Ant3	2.34	1.714	10	-	-	-	-	Pass
NVNT	n20	5500	Sum	6.71	4.692	10	5	-6.16	-50	50	Pass
NVNT	n20	5580	Ant1	1.71	1.483	10	-	-	-	-	Pass
NVNT	n20	5580	Ant2	3.11	2.046	10	-	-	-	-	Pass
NVNT	n20	5580	Ant3	2.94	1.968	10	-	-	-	-	Pass
NVNT	n20	5580	Sum	7.4	5.497	10	5	9.94	-50	50	Pass
NVNT	n20	5720	Ant1	2.62	1.828	10	-	-	-	-	Pass
NVNT	n20	5720	Ant2	2.58	1.811	10	-	-	-	-	Pass
NVNT	n20	5720	Ant3	2.73	1.875	10	-	-	-	-	Pass
NVNT	n20	5720	Sum	7.41	5.514	10	5	10.28	-50	50	Pass
NVNT	n40	5510	Ant1	-1.14	0.769	5	-	-	-	-	Pass
NVNT	n40	5510	Ant2	0.09	1.021	5	-	-	-	-	Pass
NVNT	n40	5510	Ant3	0.11	1.026	5	-	-	-	-	Pass
NVNT	n40	5510	Sum	4.5	2.816	5	2	40.8	-50	50	Pass
NVNT	n40	5590	Ant1	-0.97	0.8	5	-	-	-	-	Pass
NVNT	n40	5590	Ant2	0.23	1.054	5	-	-	-	-	Pass
NVNT	n40	5590	Ant3	-0.03	0.993	5	-	-	-	-	Pass
NVNT	n40	5590	Sum	4.54	2.847	5	2	42.35	-50	50	Pass
NVNT	n40	5710	Ant1	-0.27	0.94	5	-	-	-	-	Pass
NVNT	n40	5710	Ant2	-0.53	0.885	5	-	-	-	-	Pass
NVNT	n40	5710	Ant3	-0.33	0.927	5	-	-	-	-	Pass
NVNT	n40	5710	Sum	4.4	2.752	5	2	37.6	-50	50	Pass



Test Graphs



Power NVNT a 5500MHz Ant1 Pre Scan

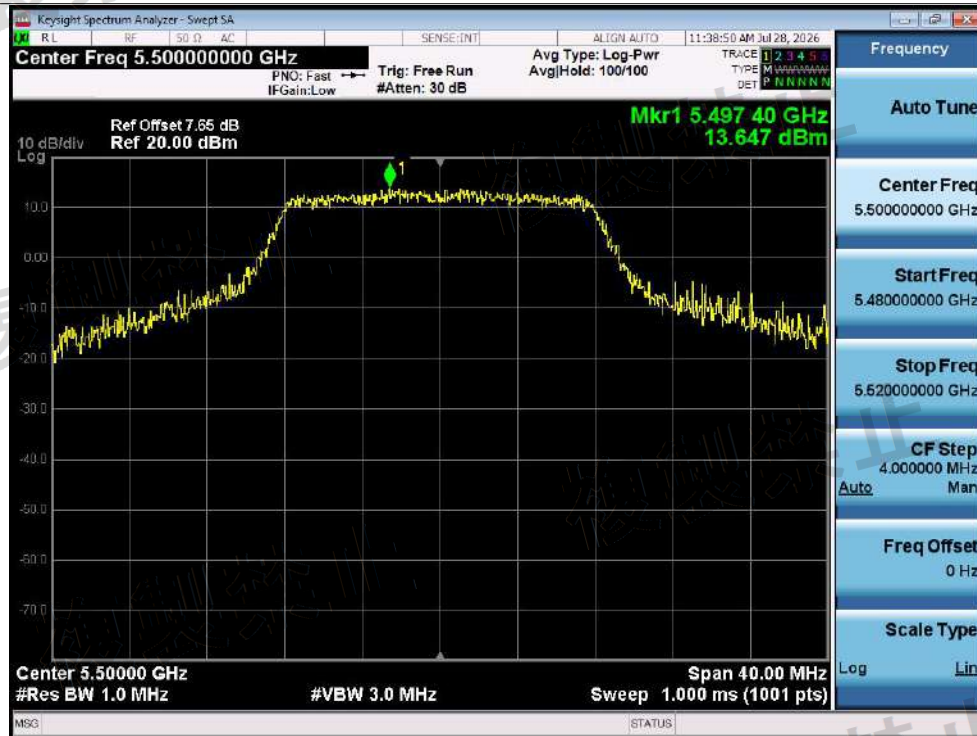


Power NVNT a 5500MHz Ant1 Zero Span


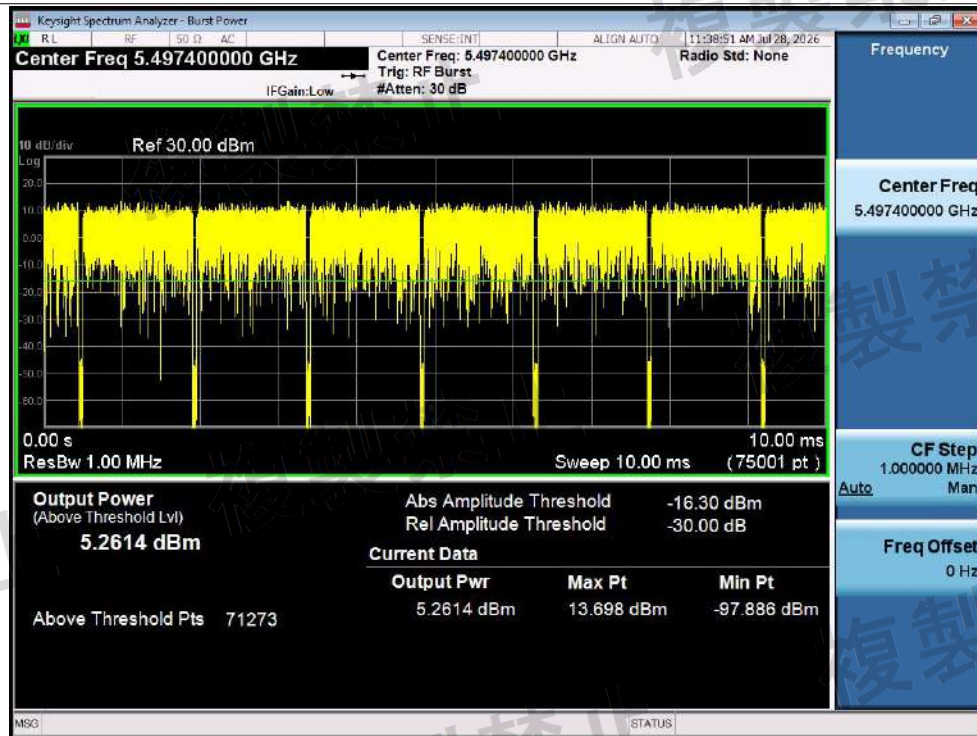


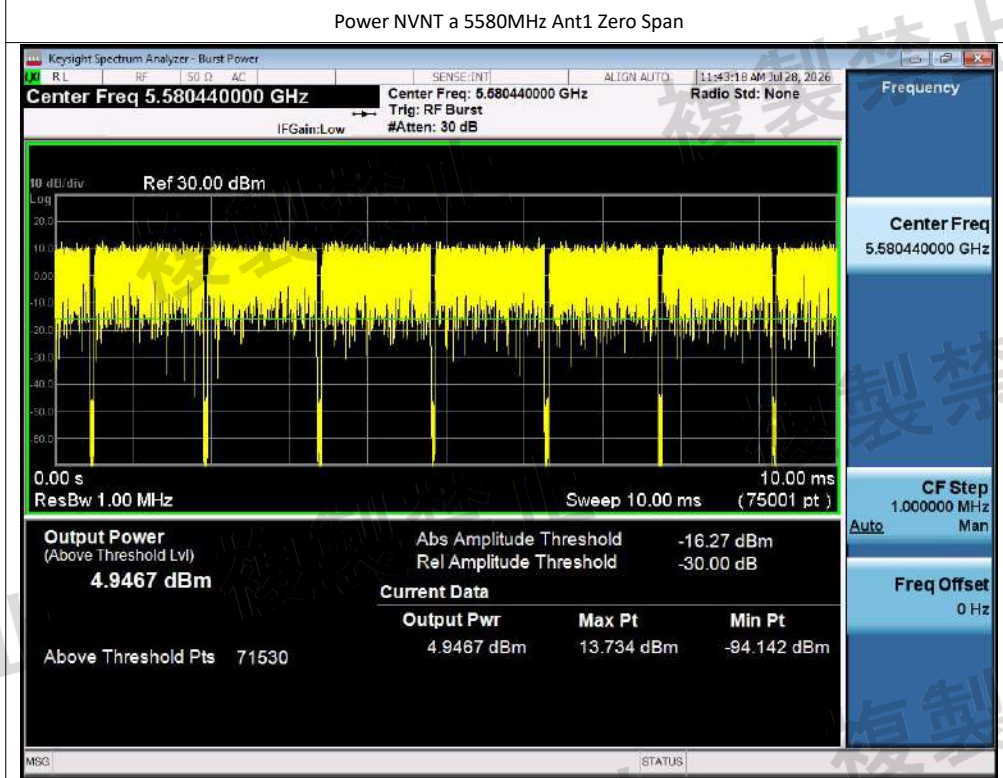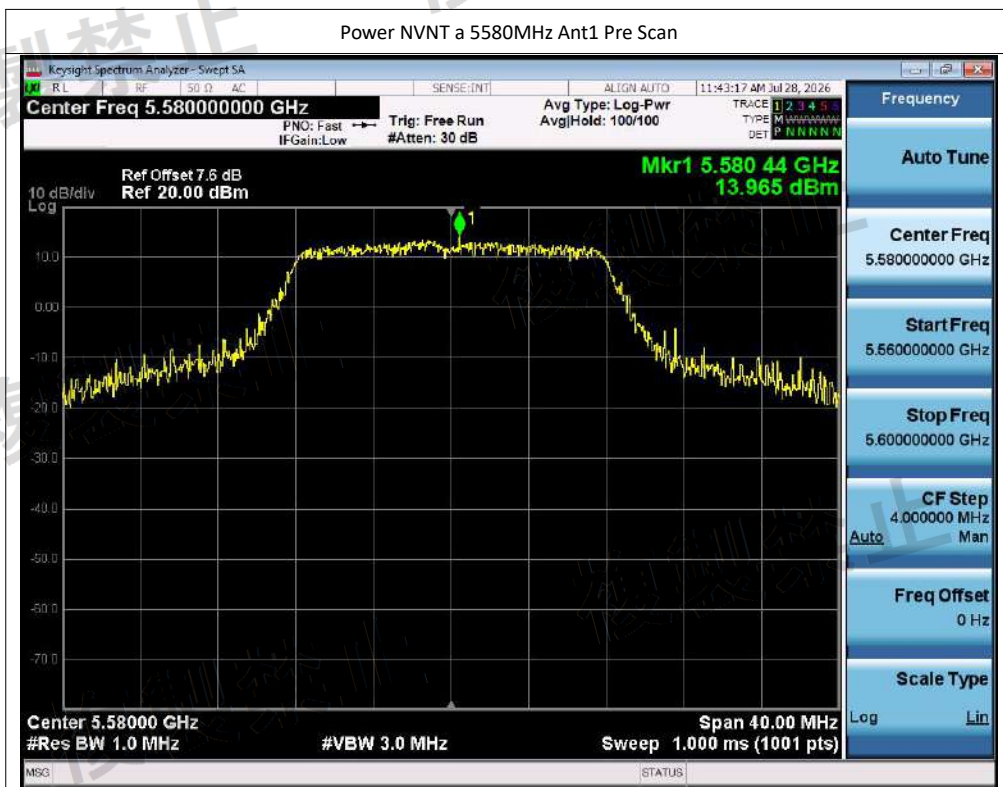


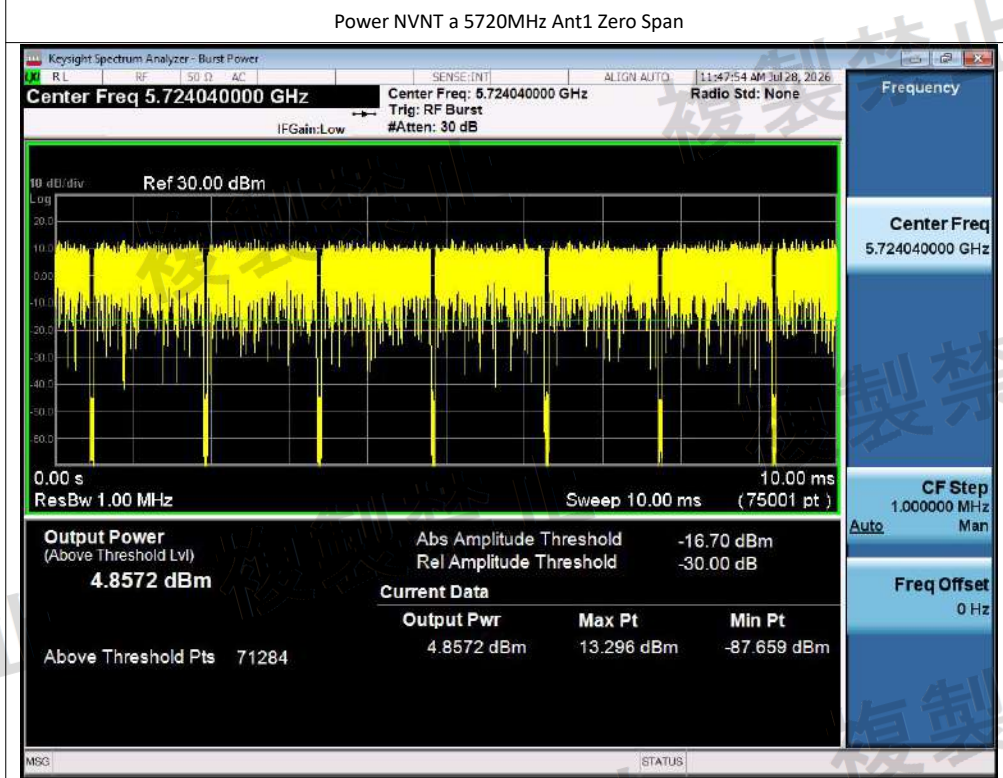
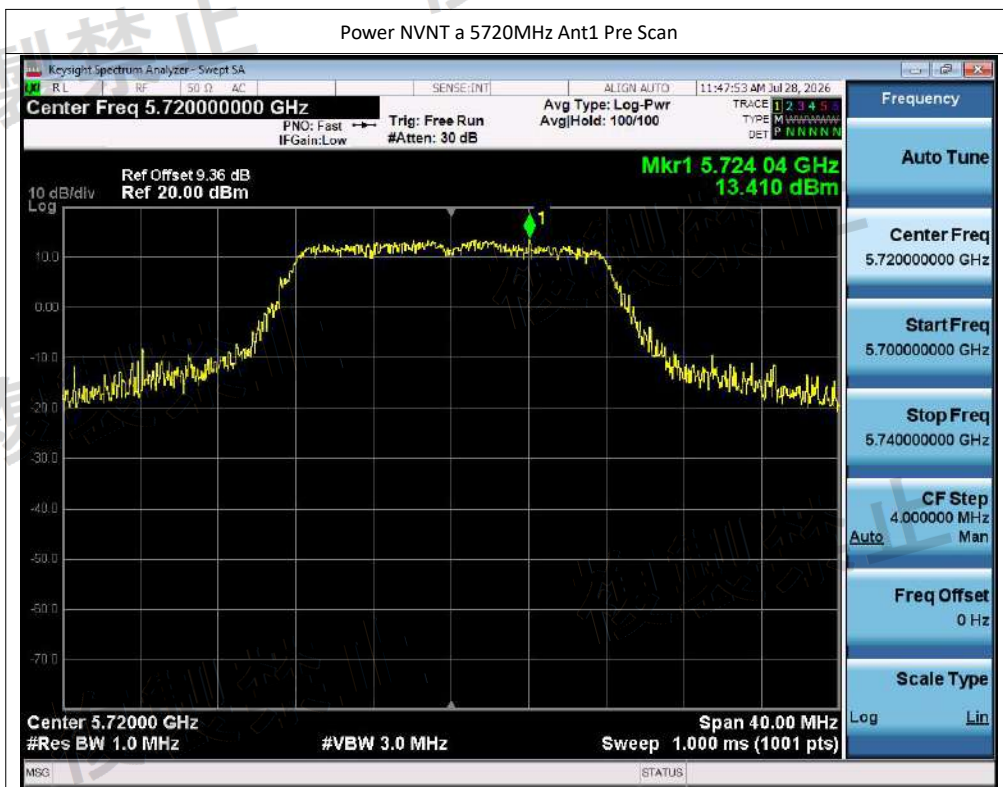


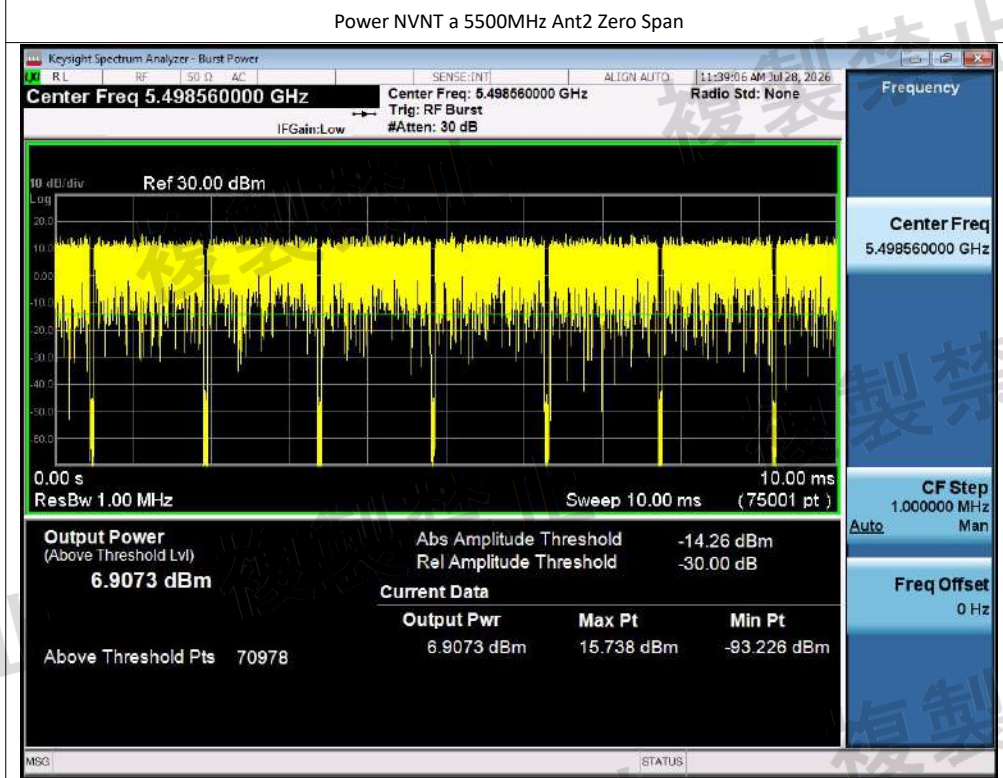





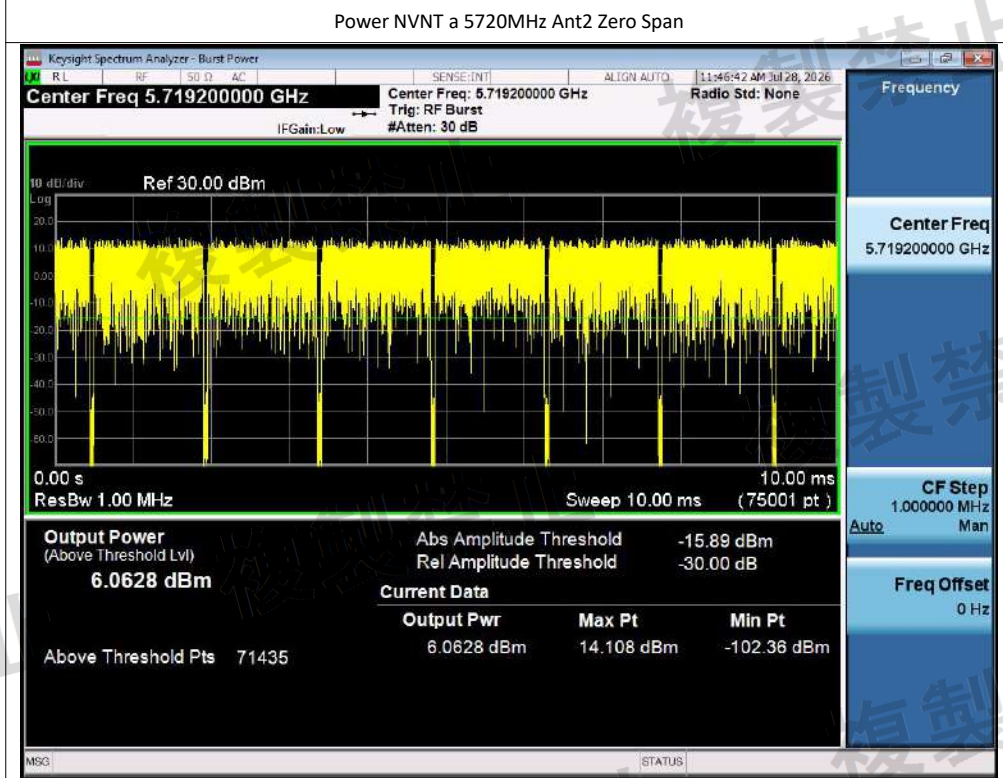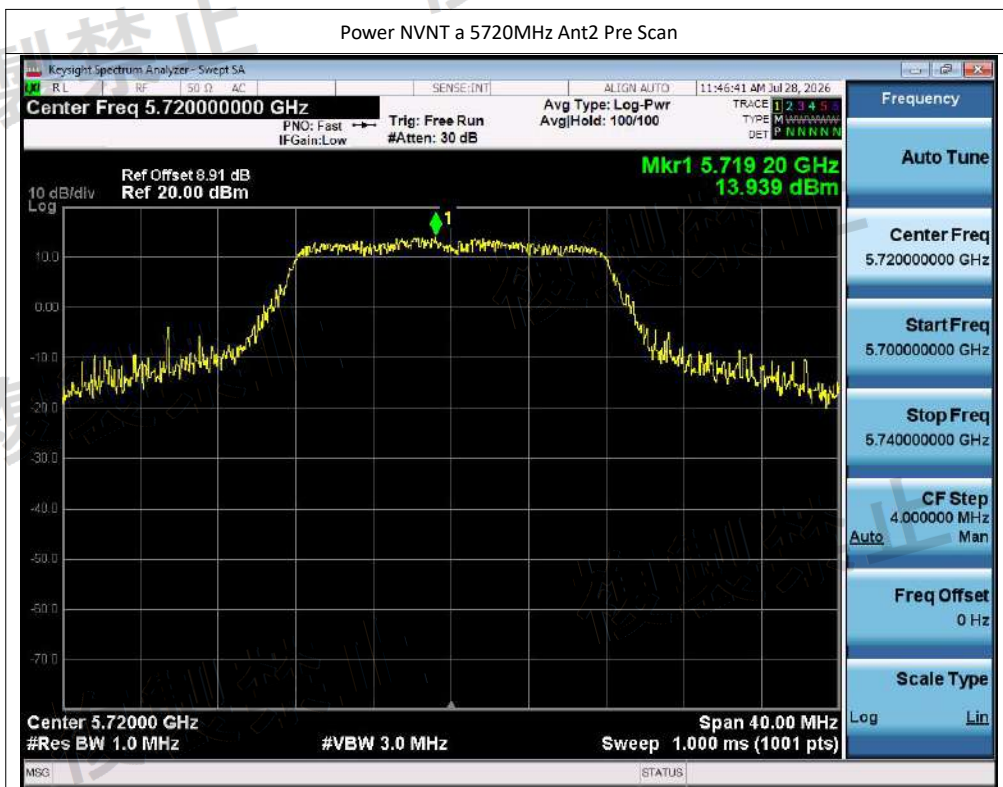


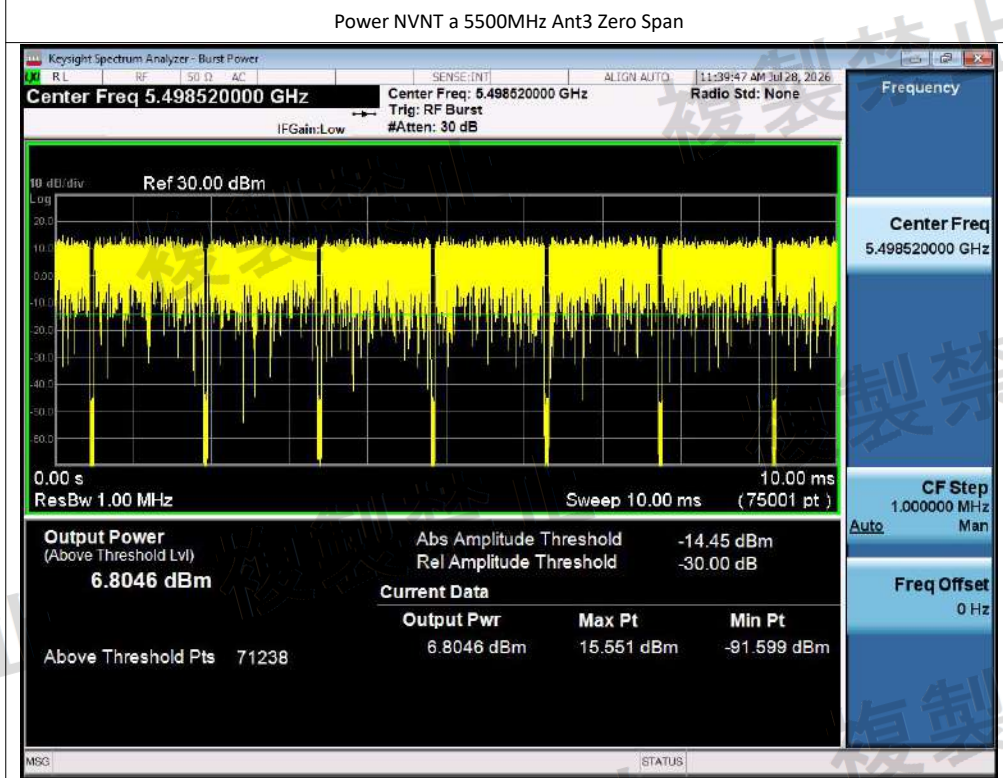


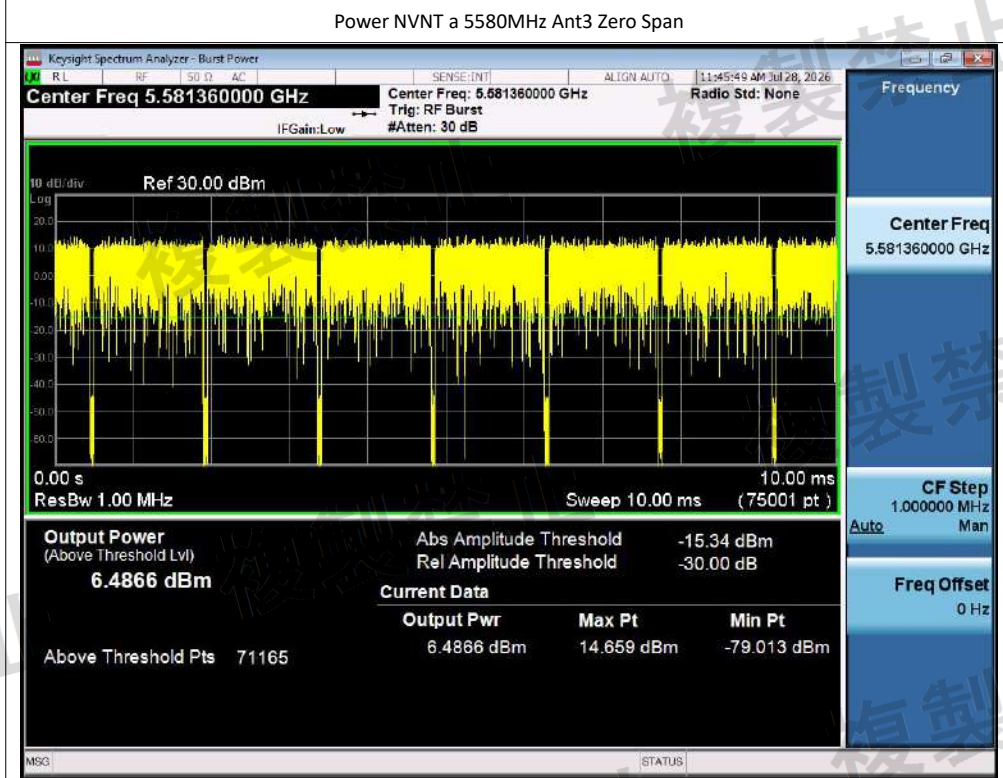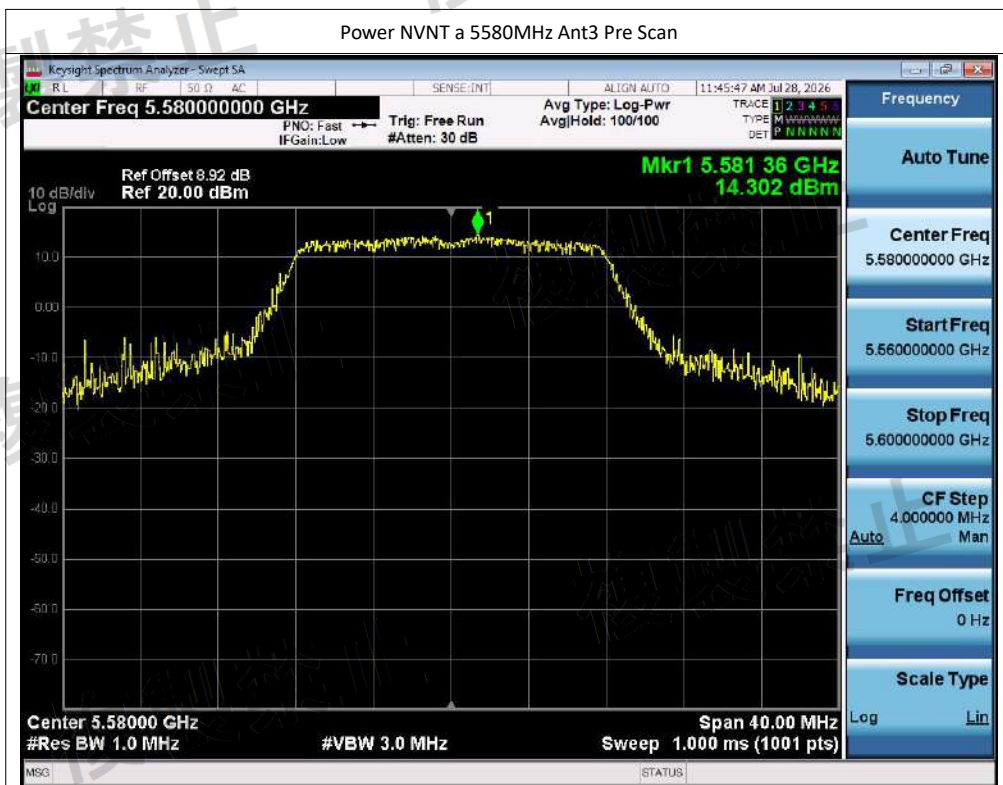


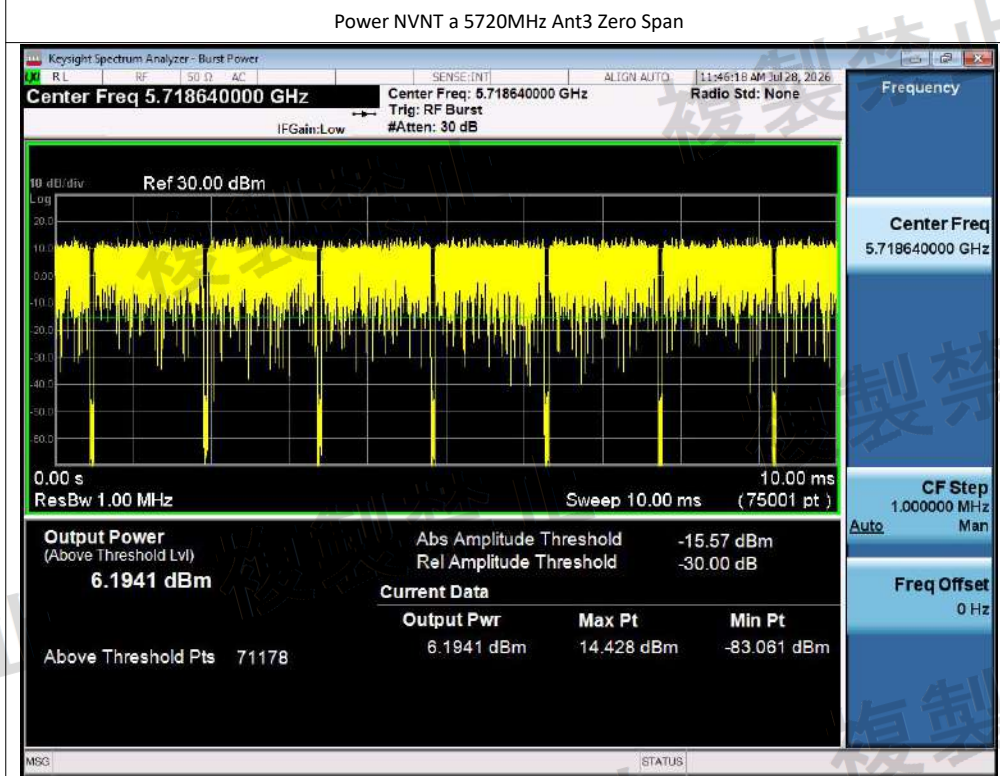


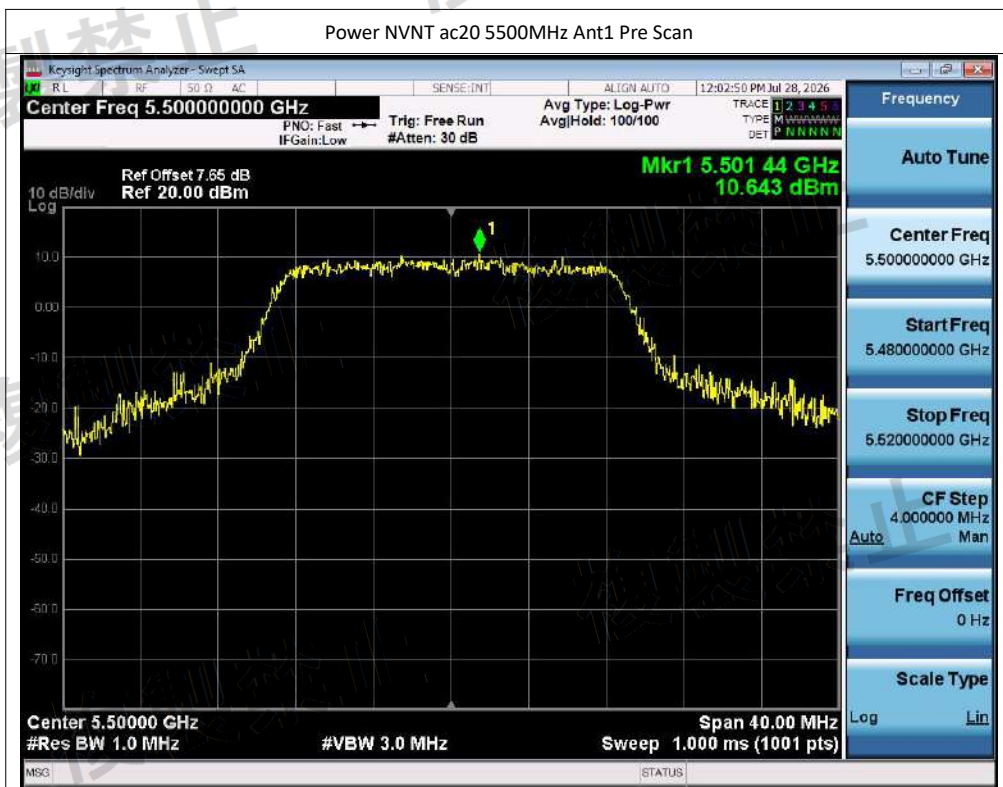


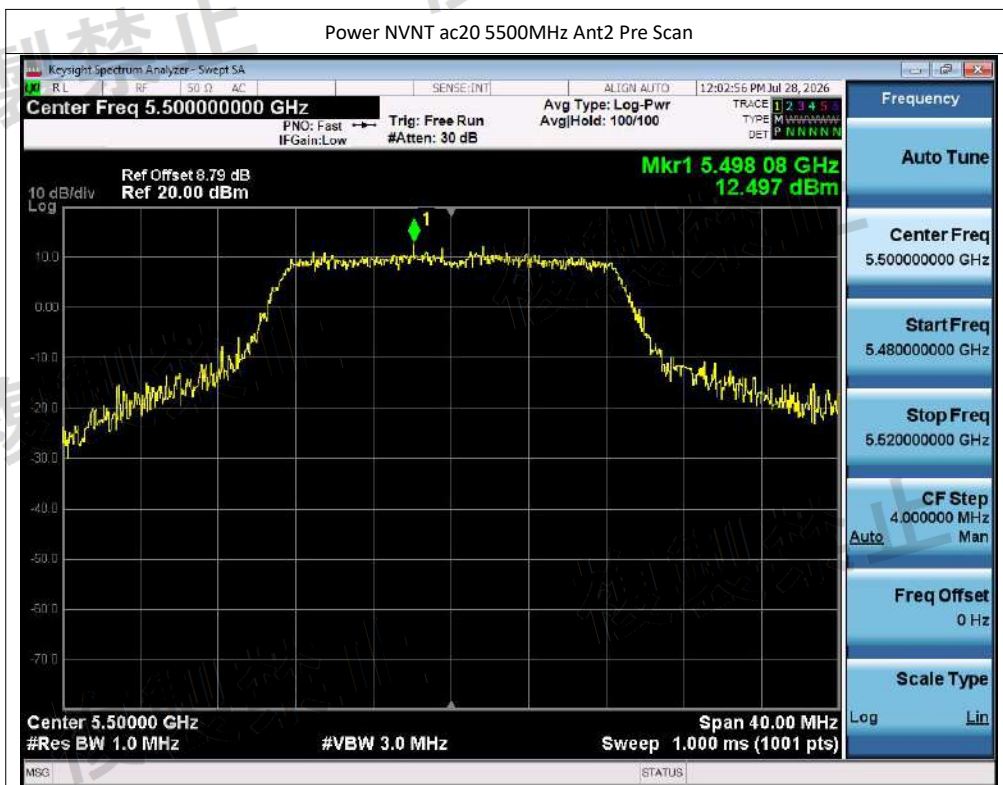


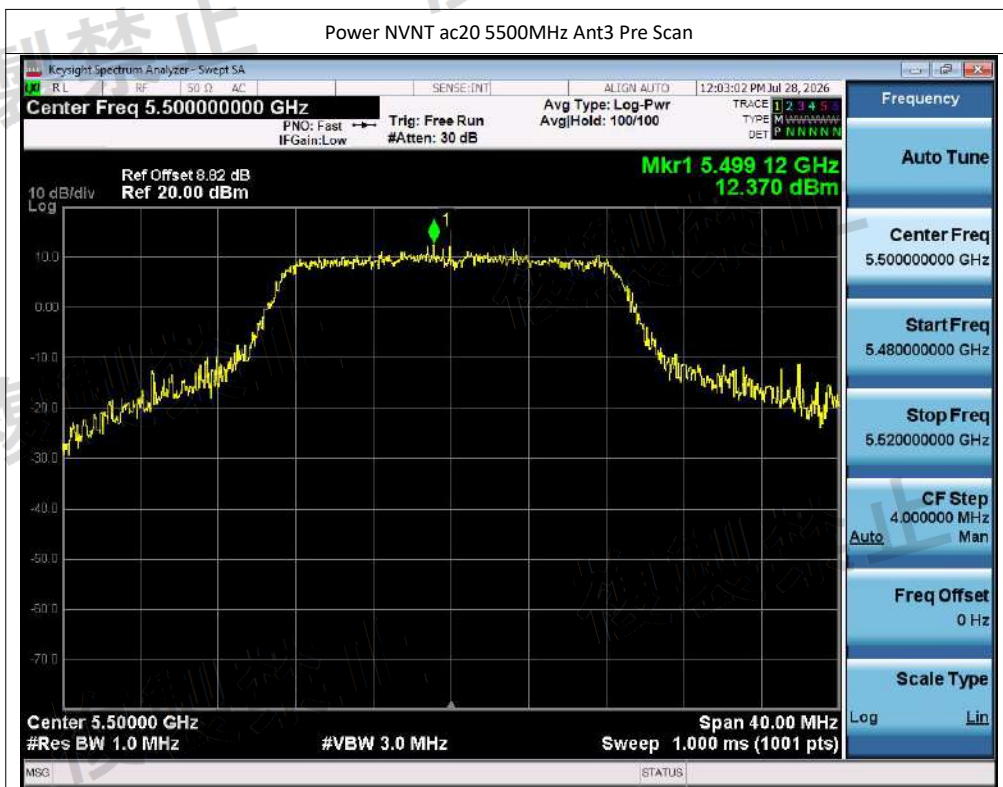

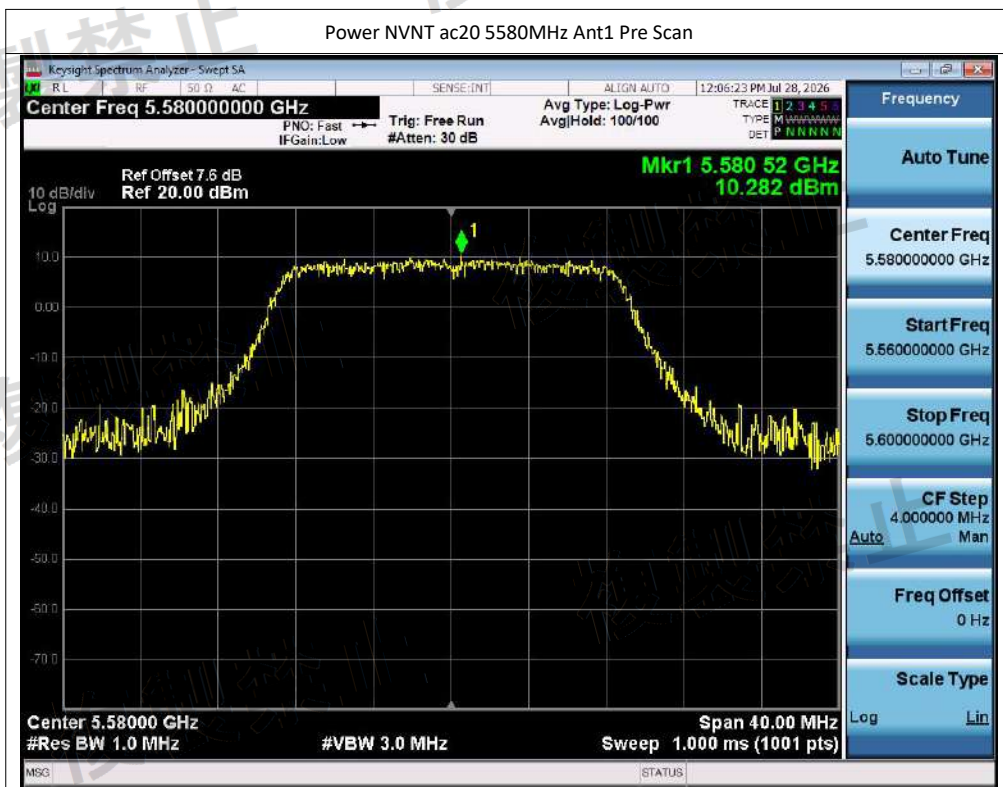


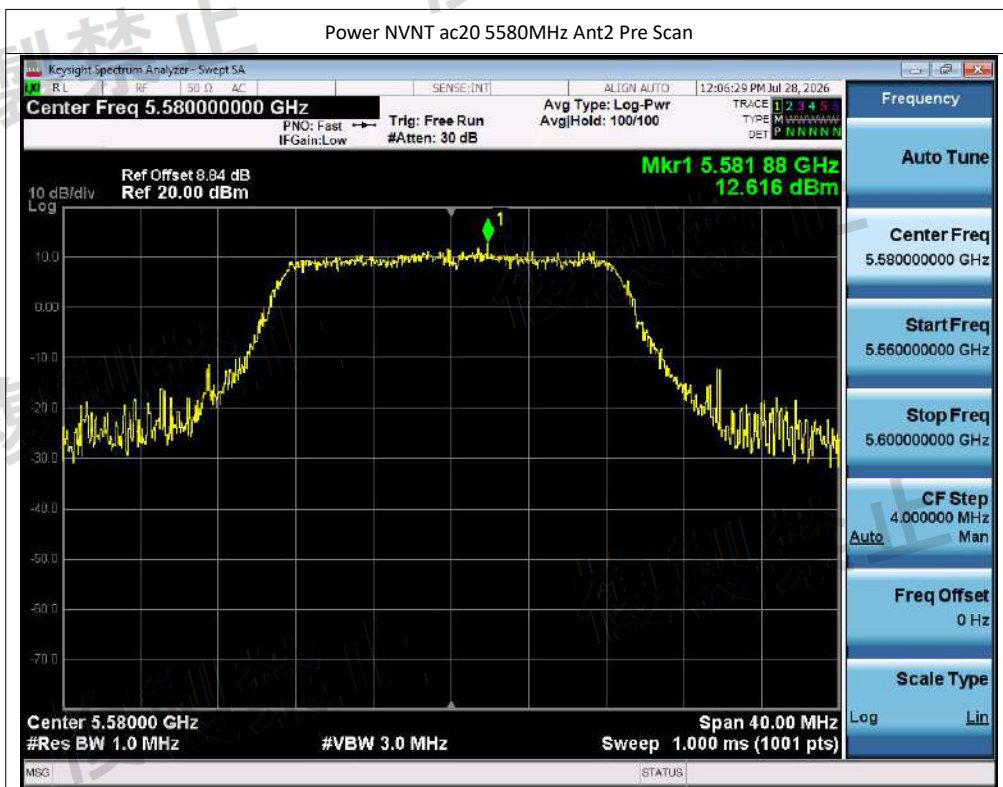

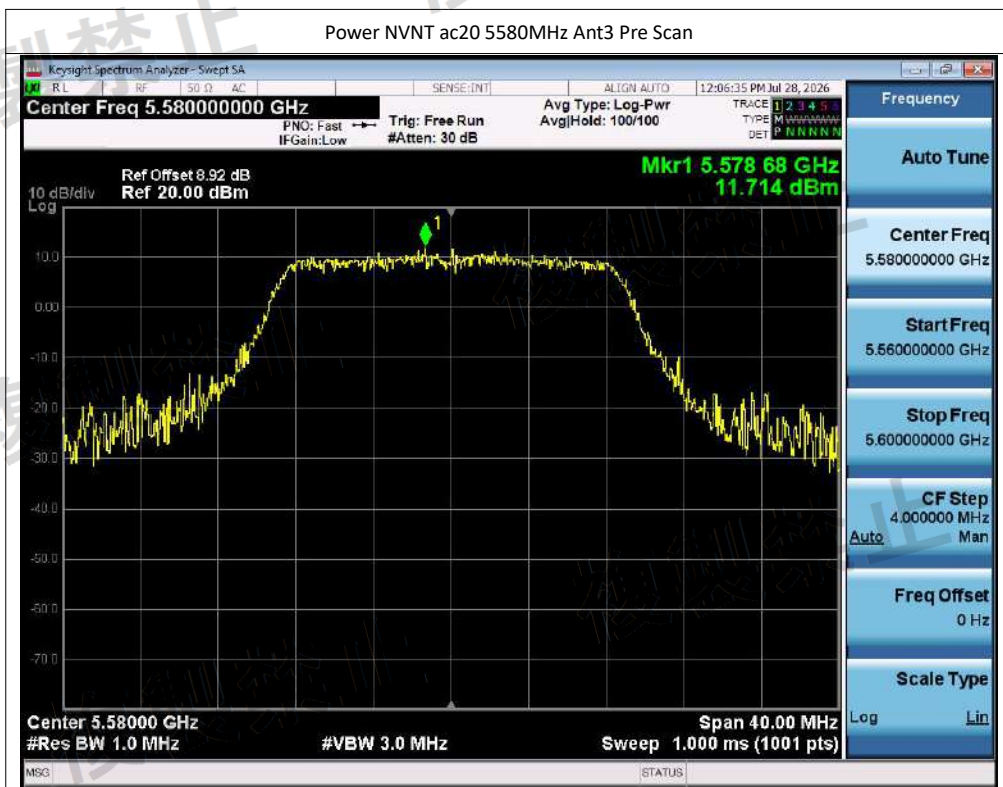

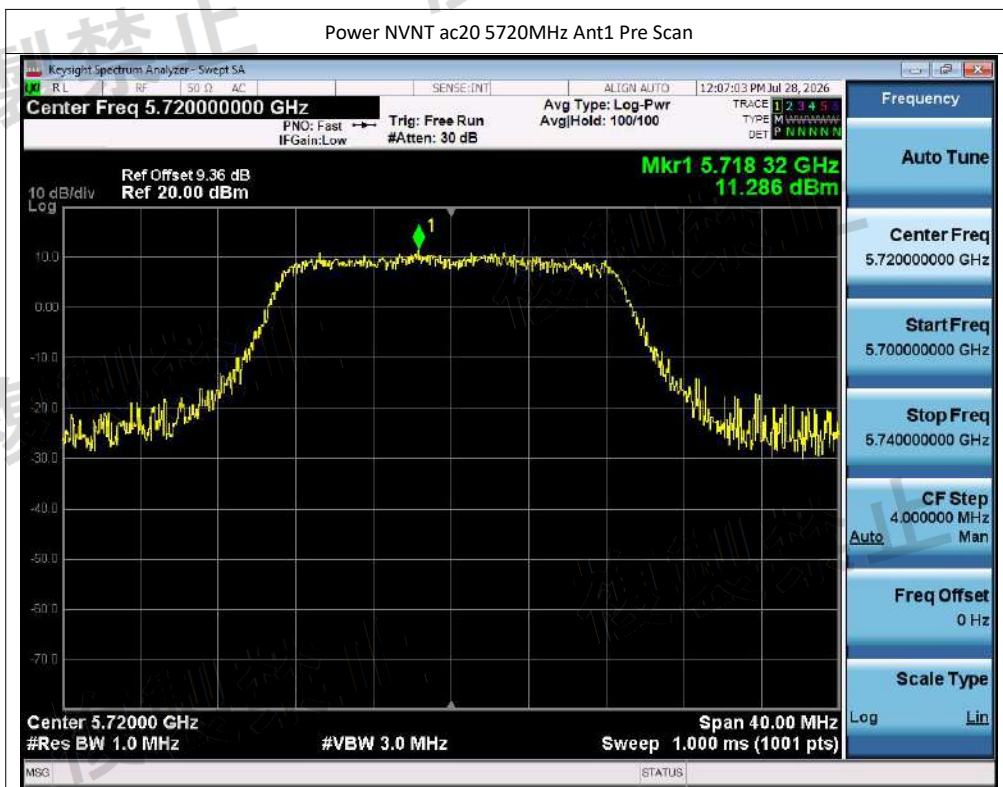





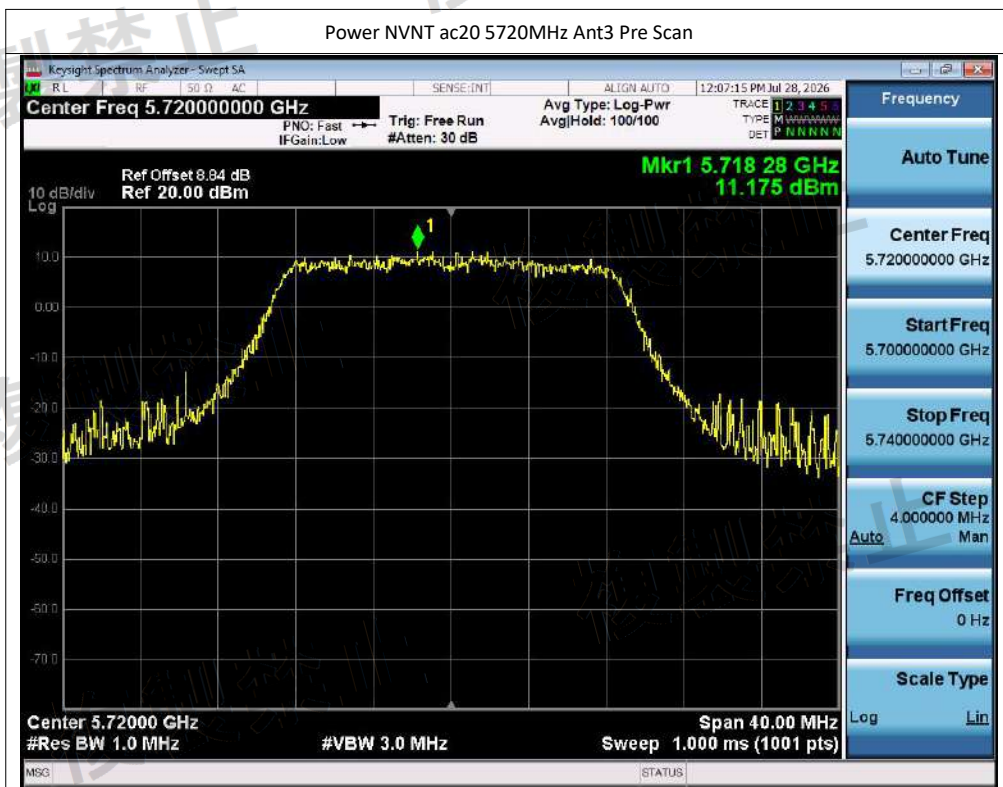








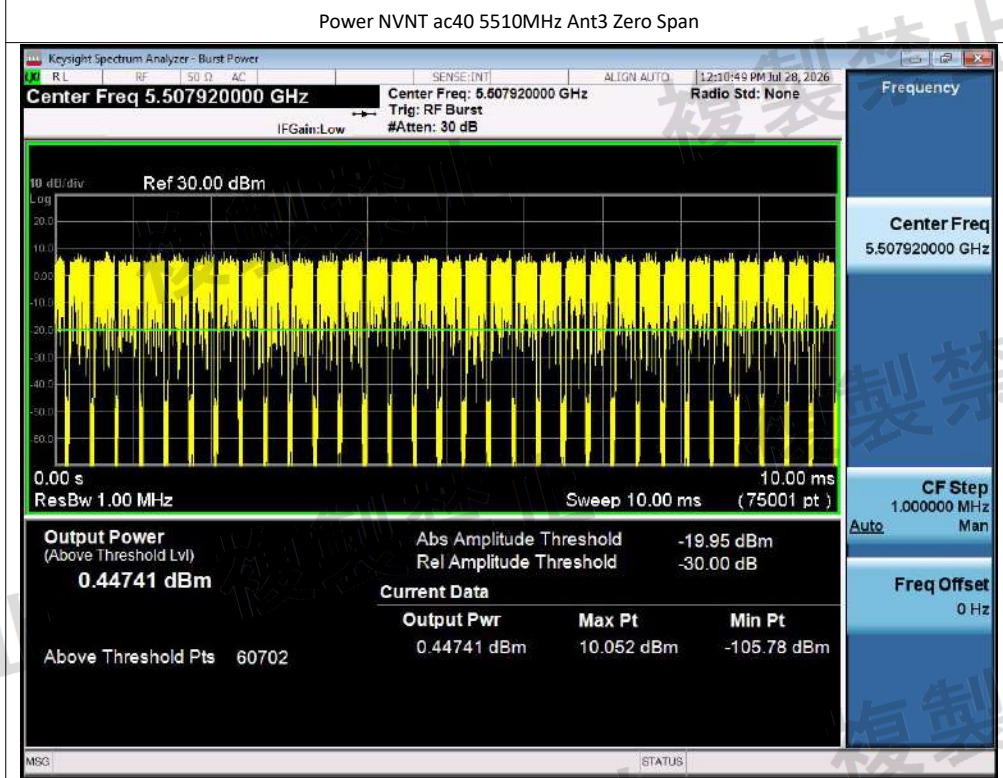

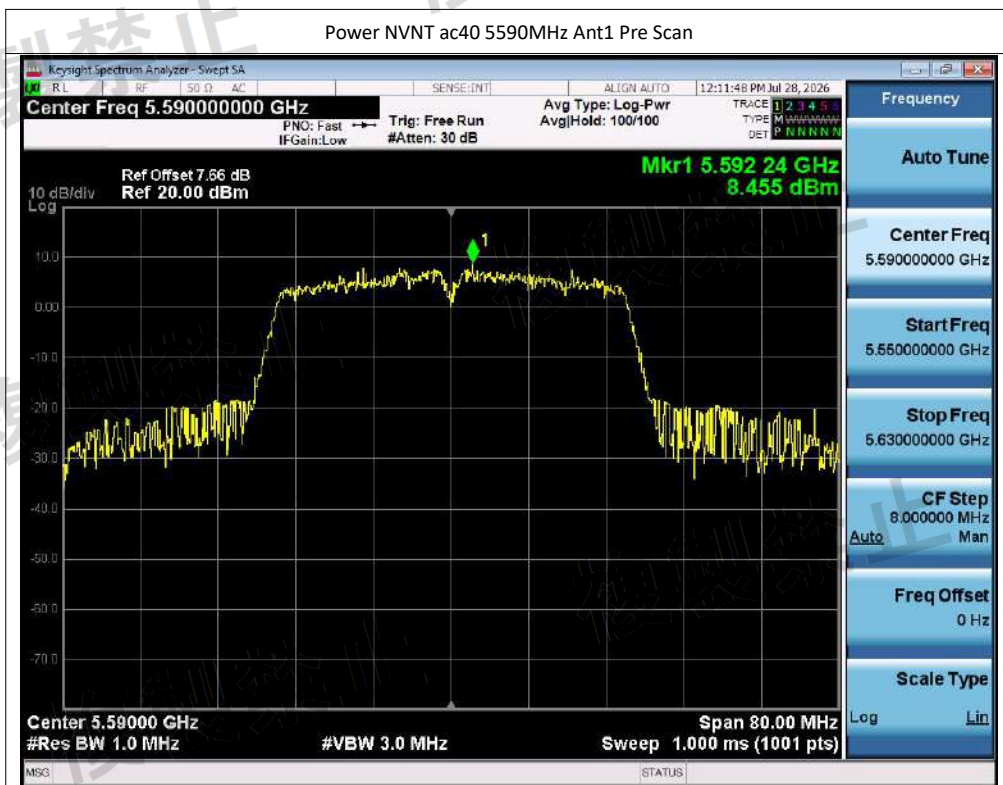

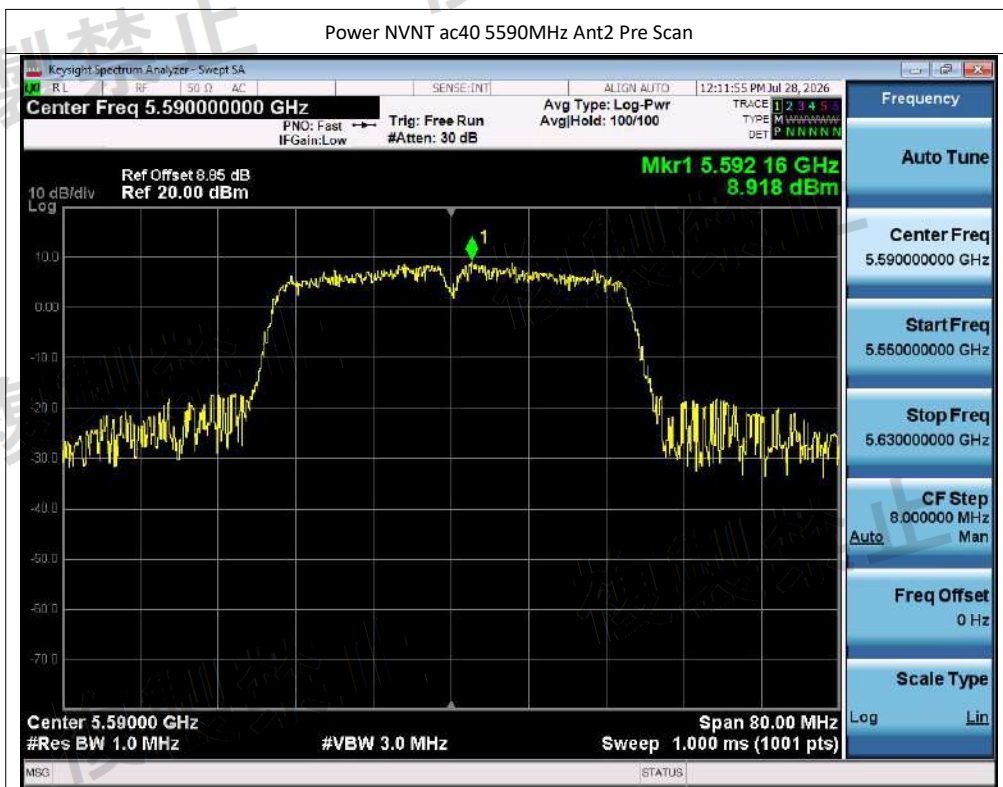

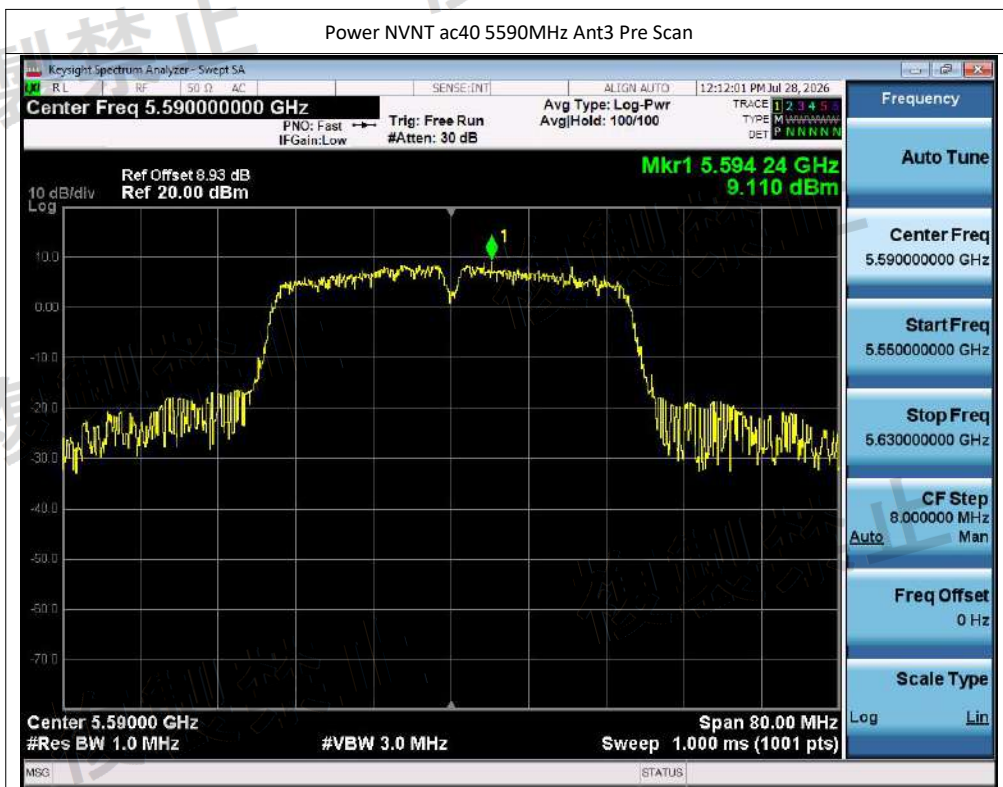

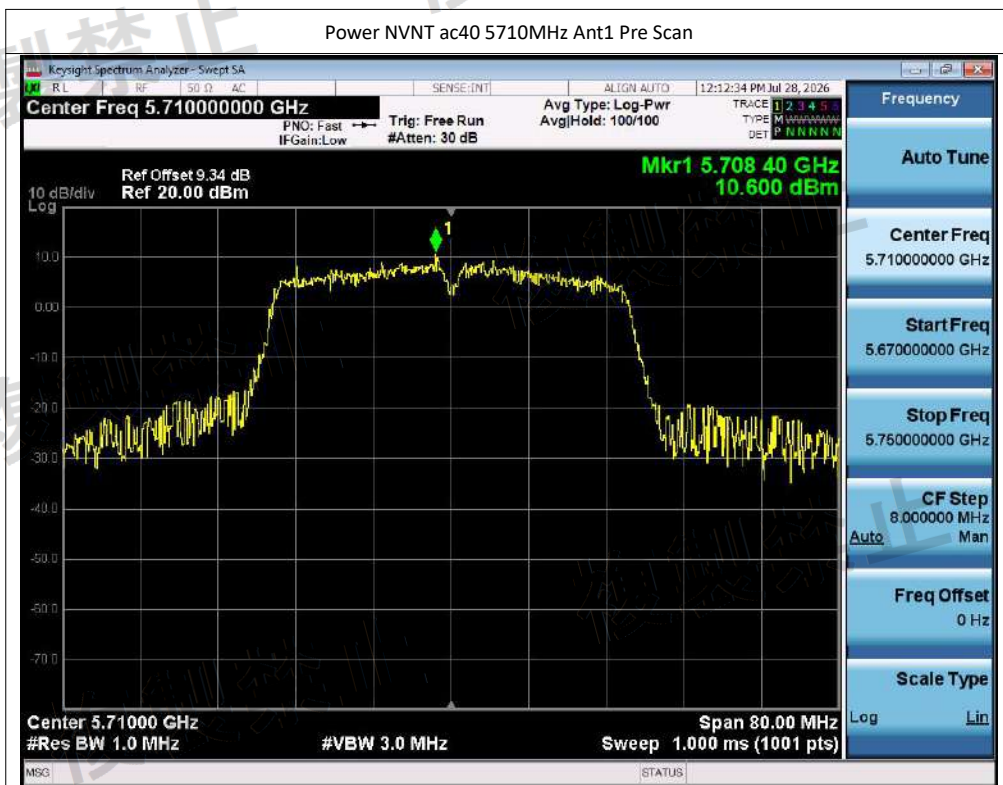















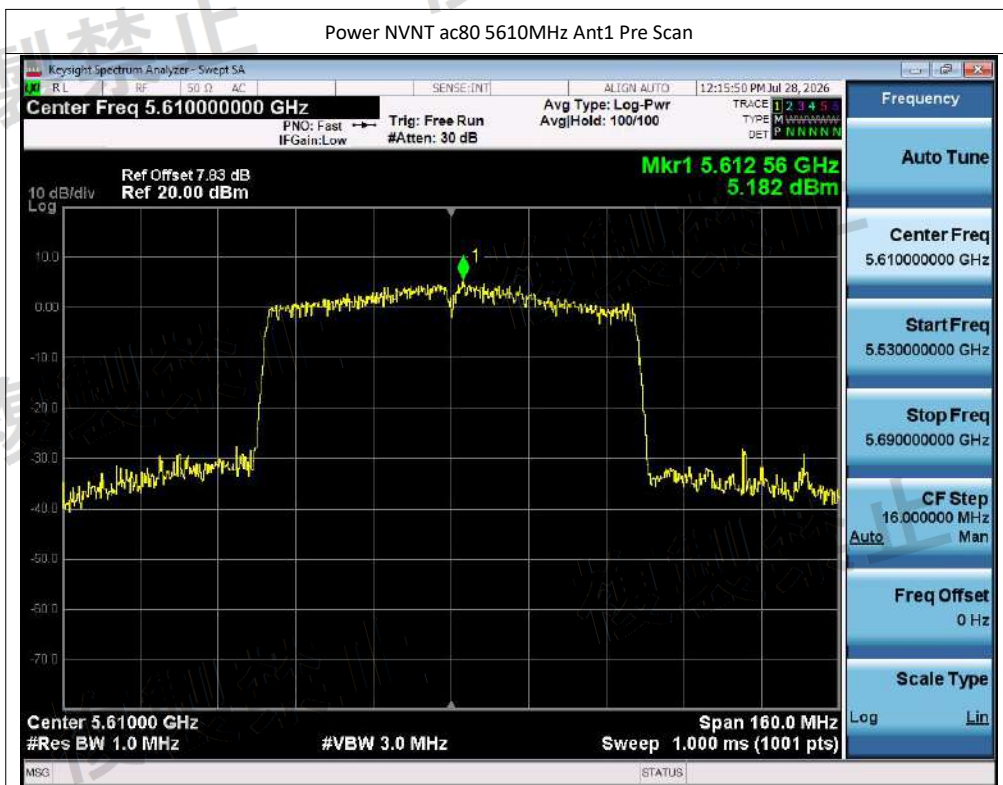

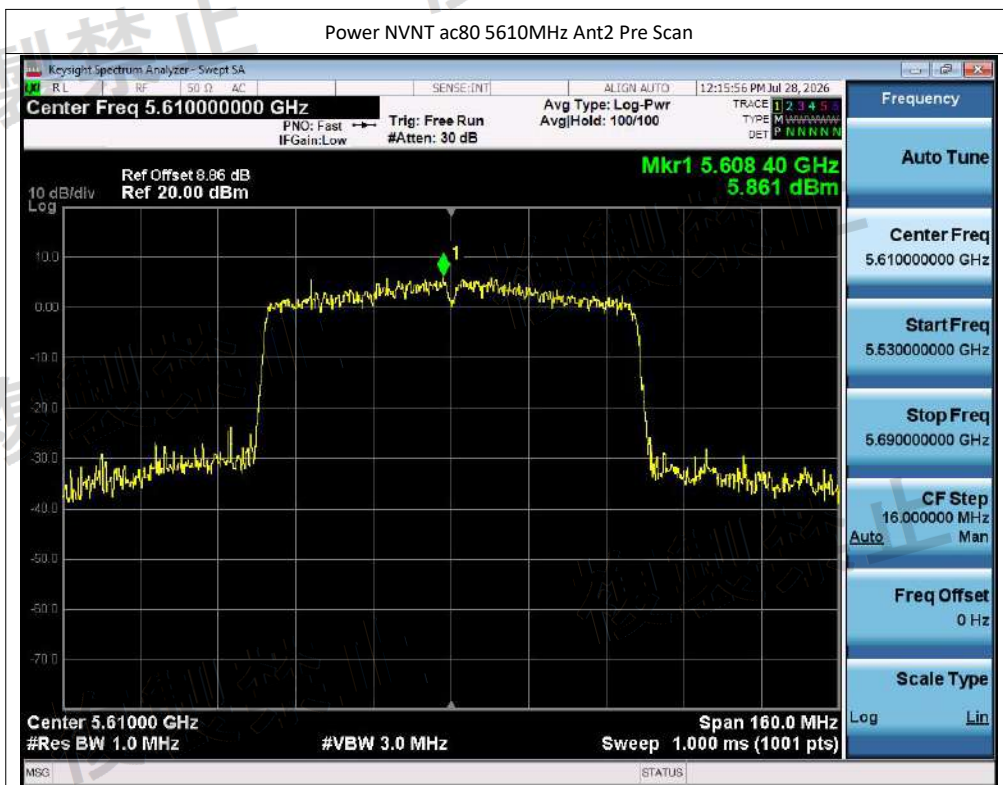






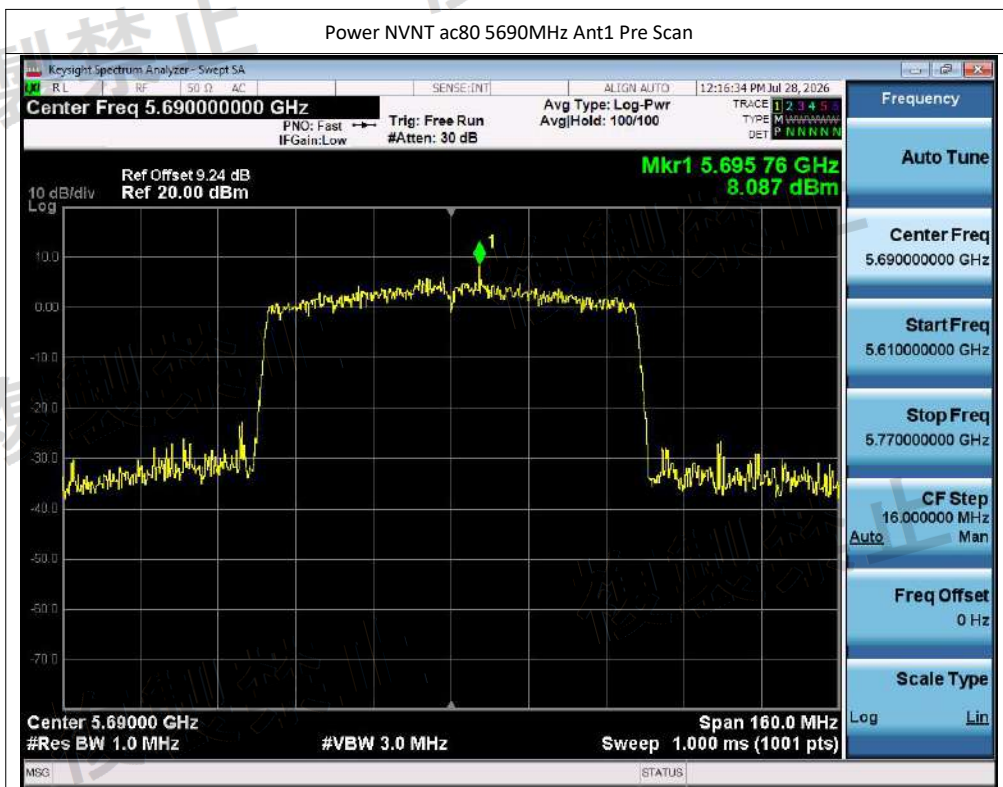


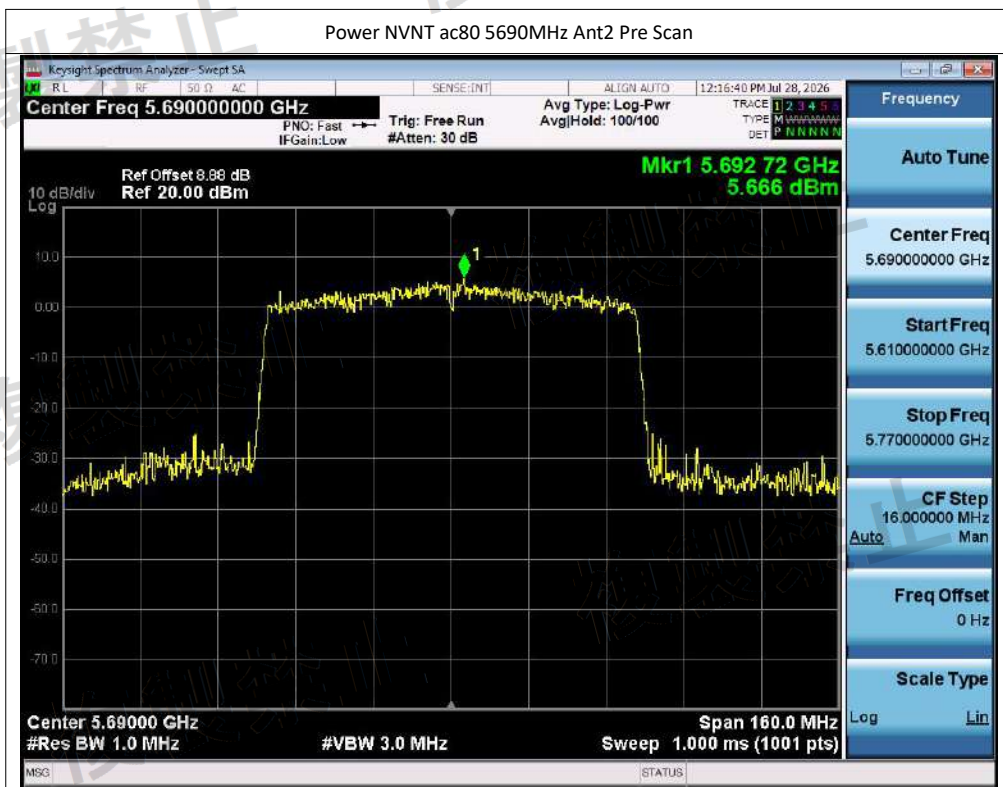





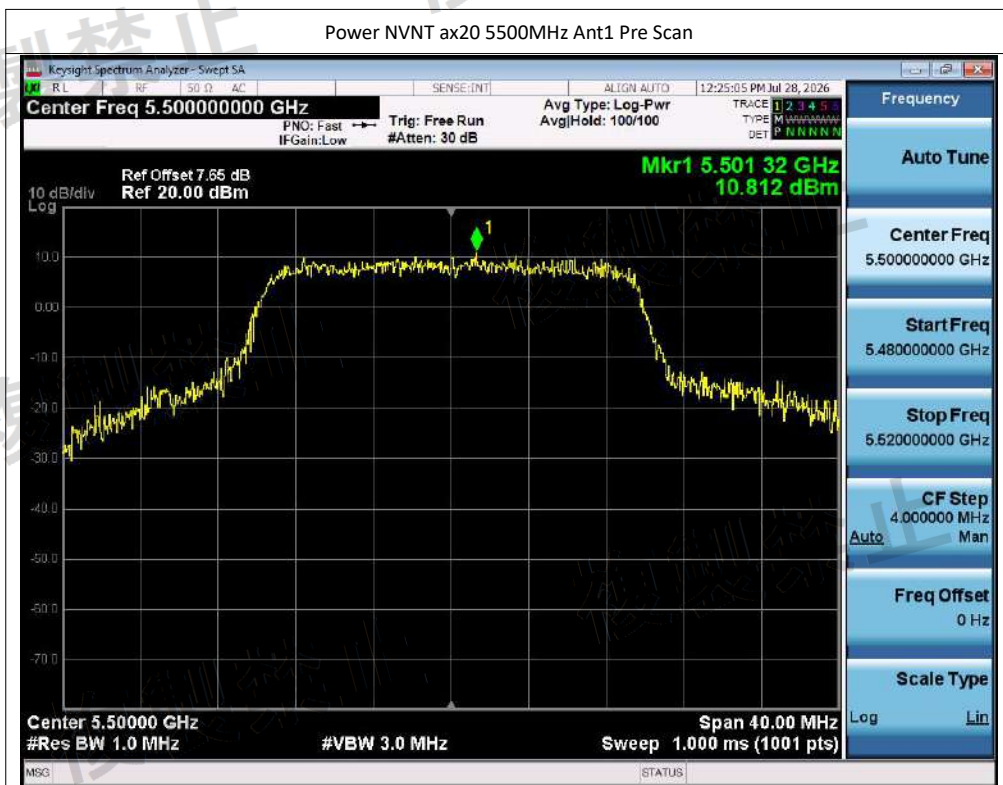


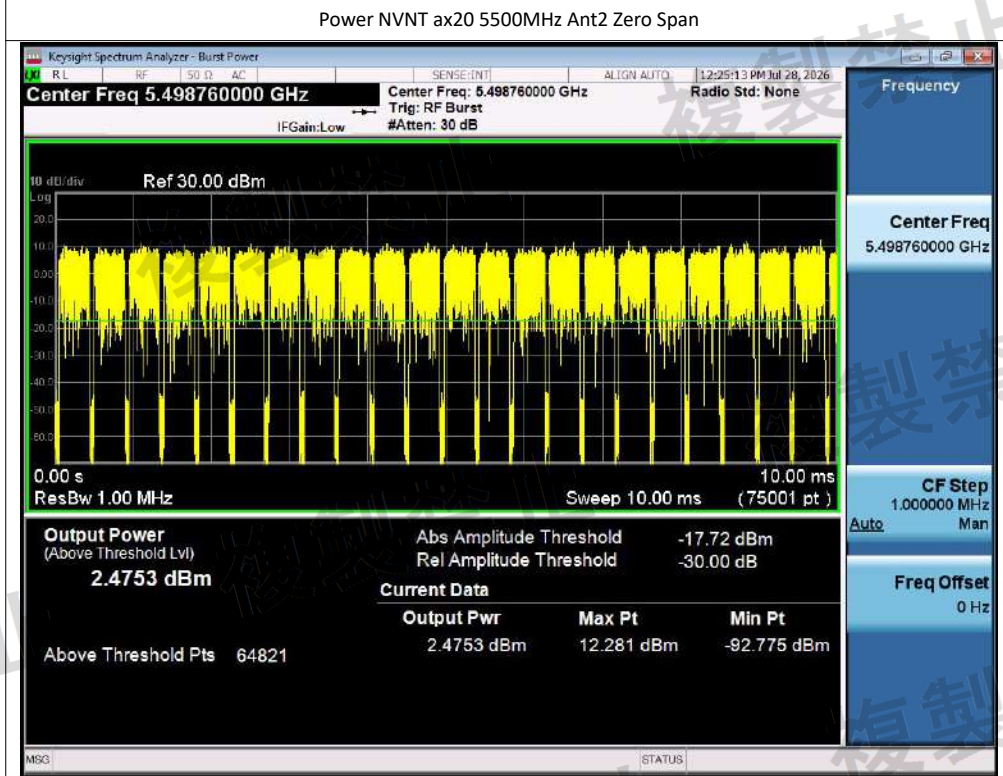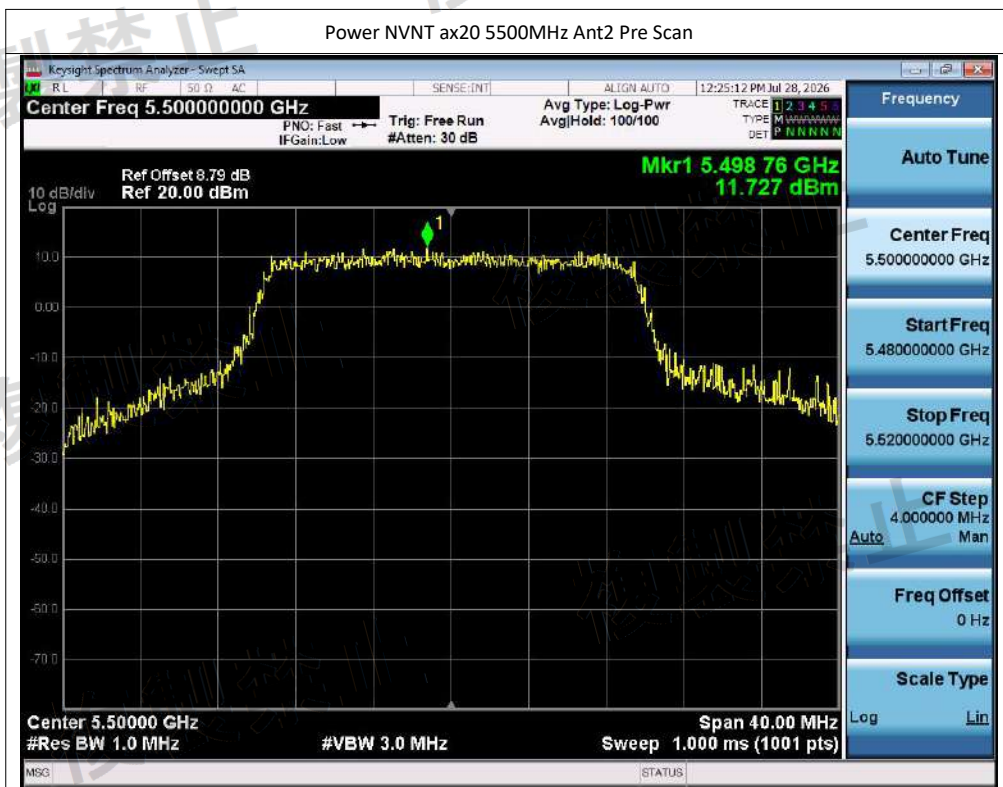


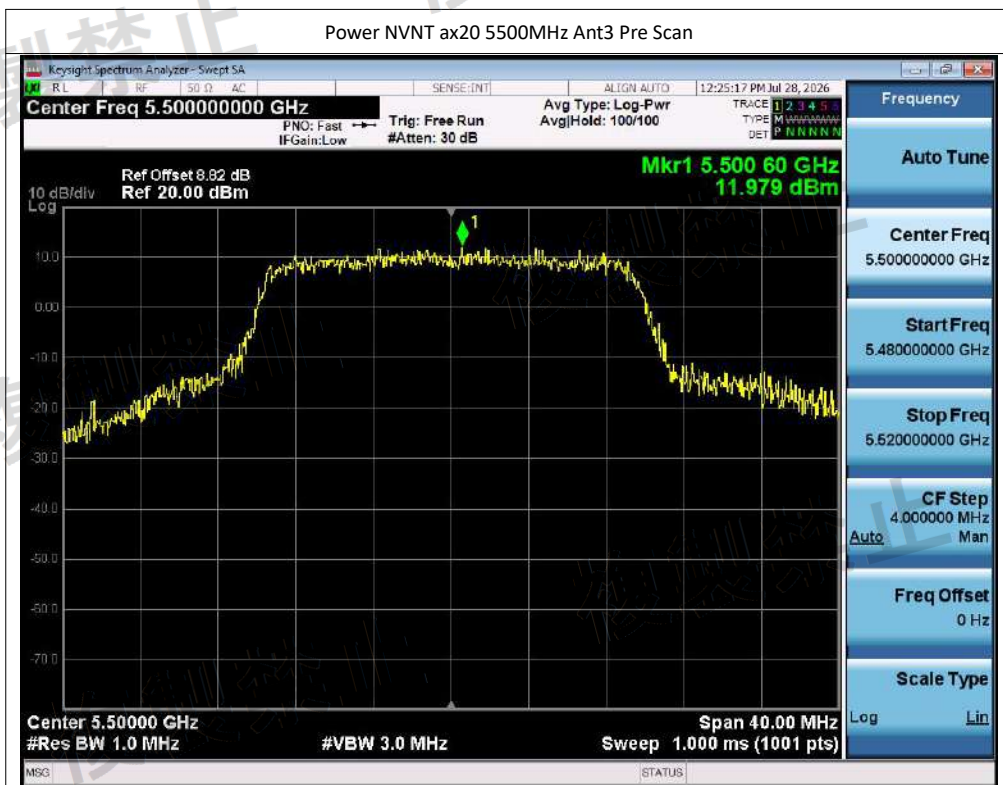


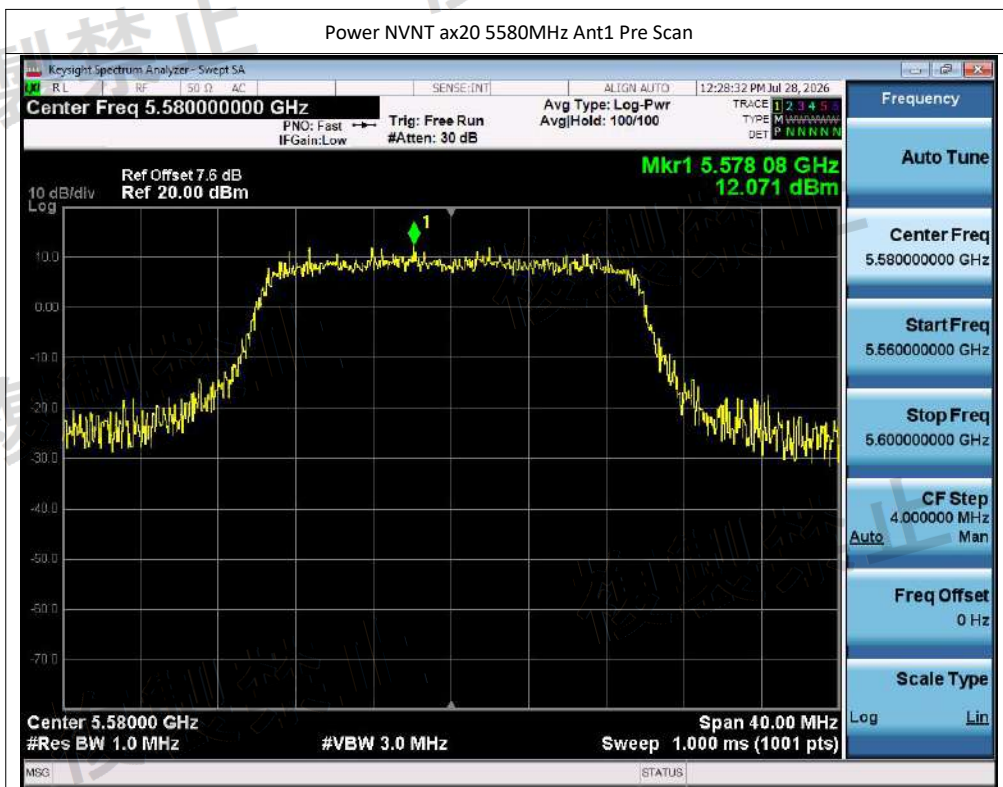


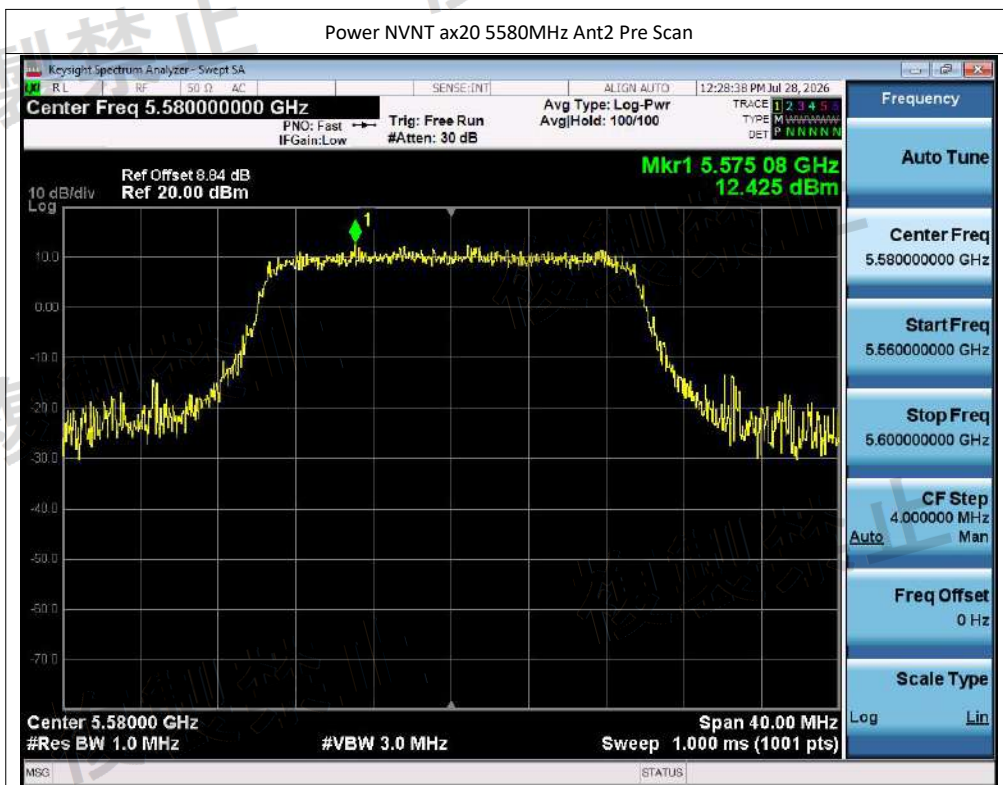

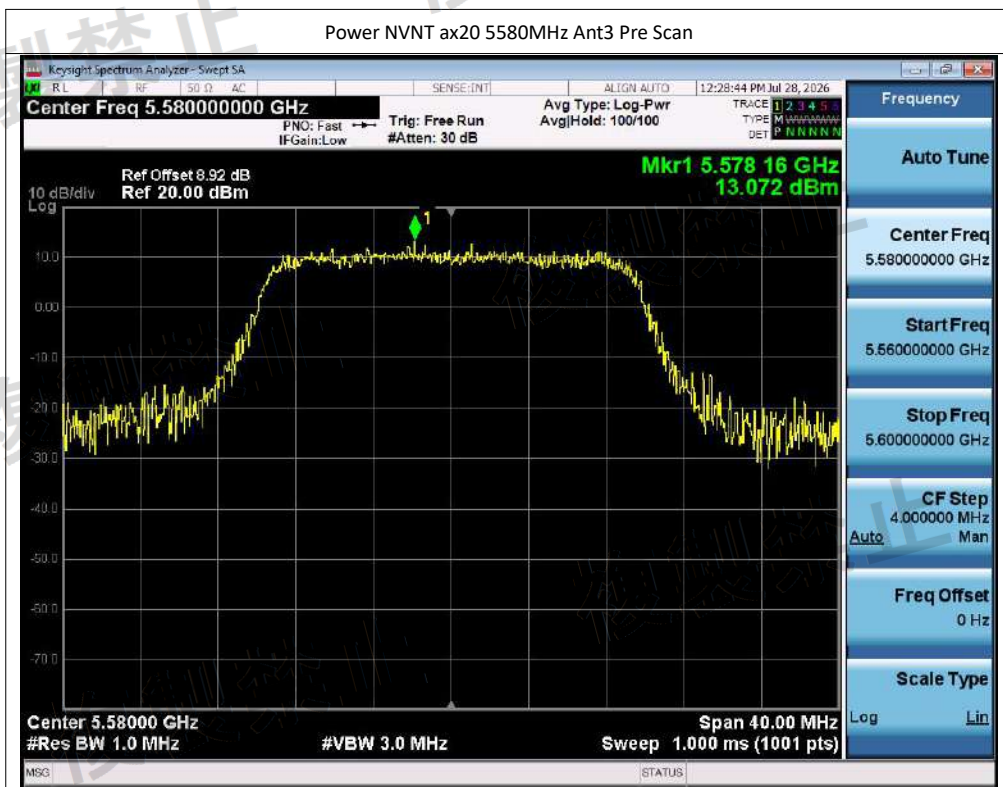

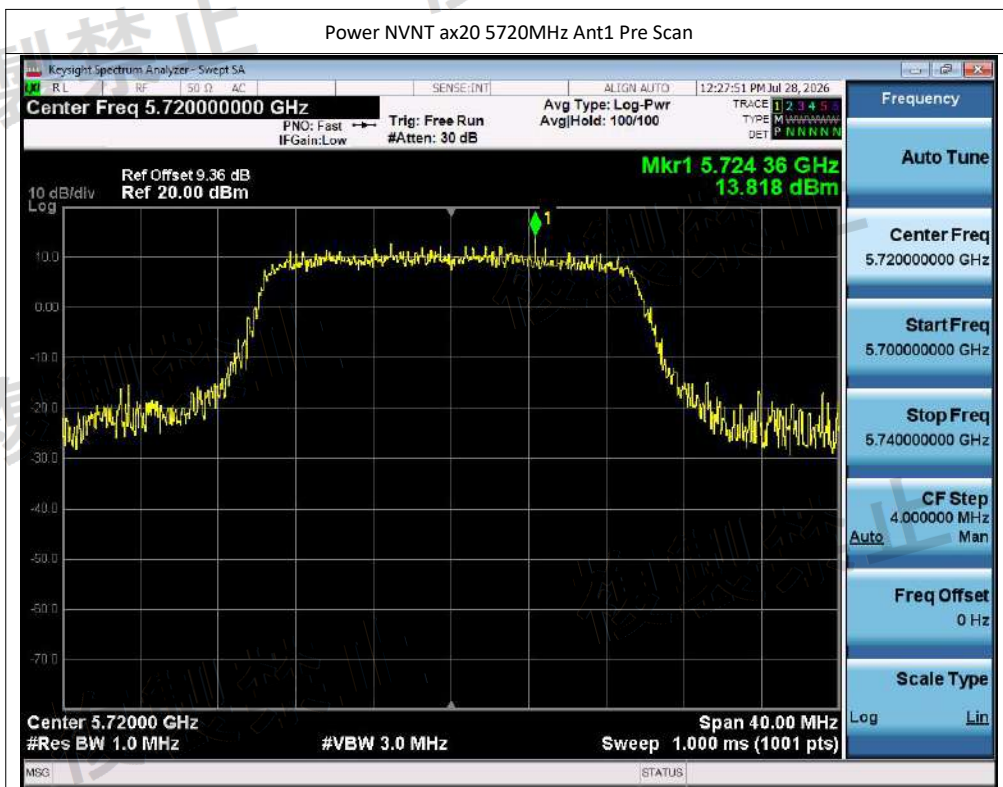

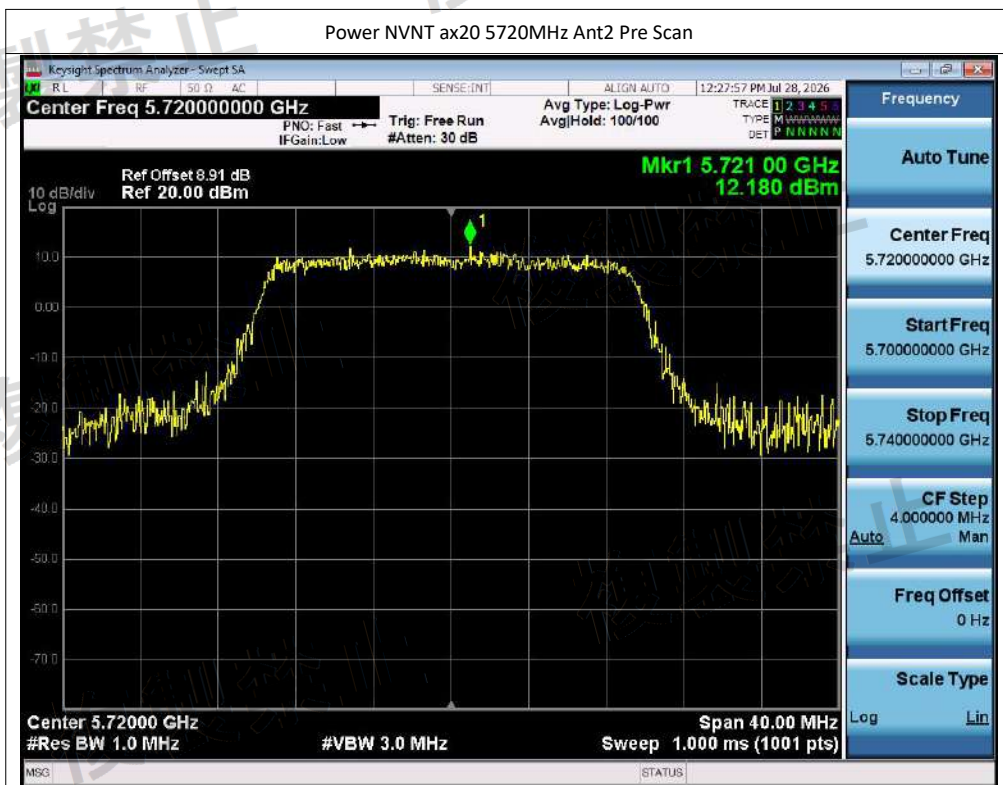


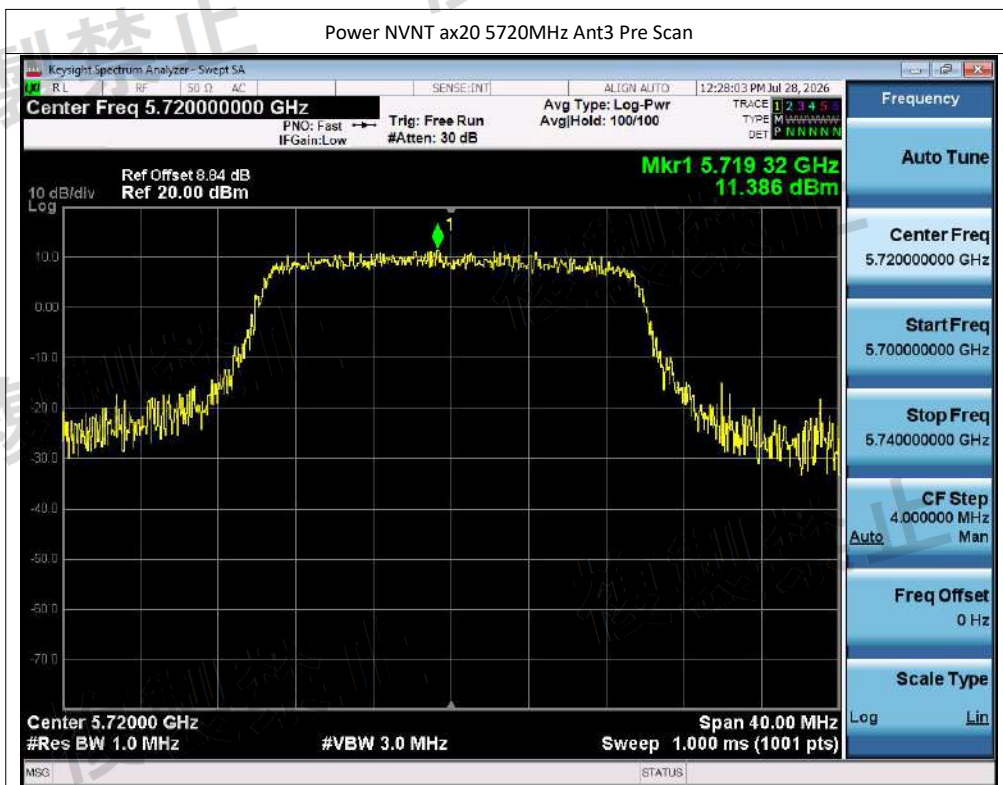











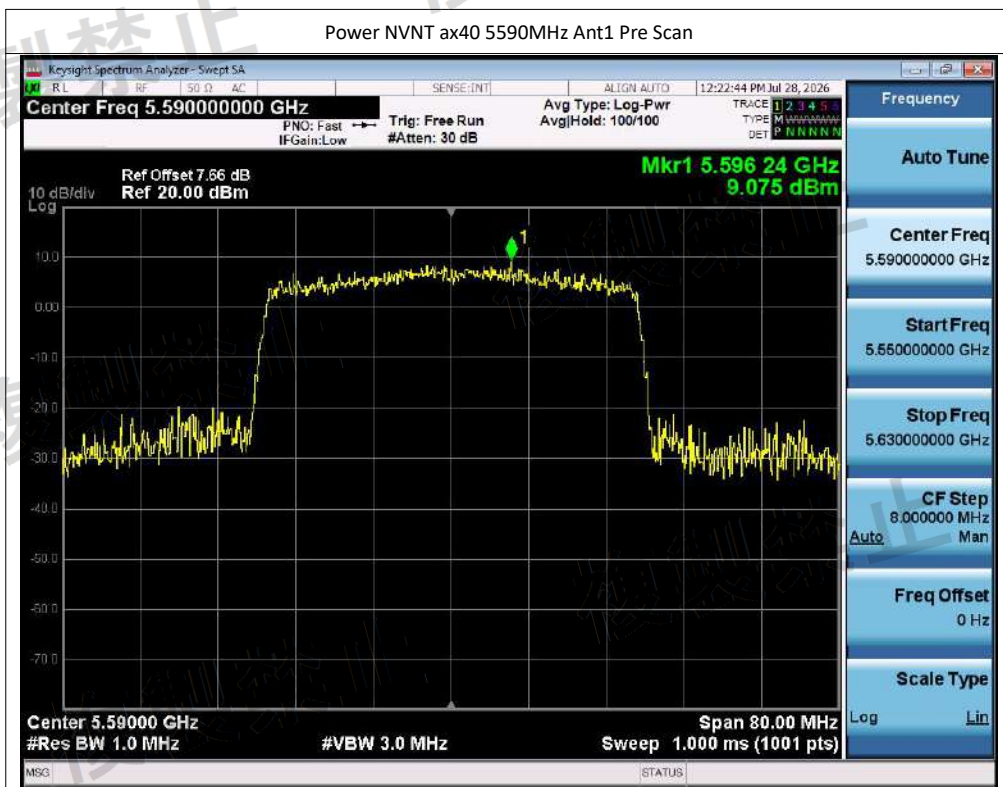


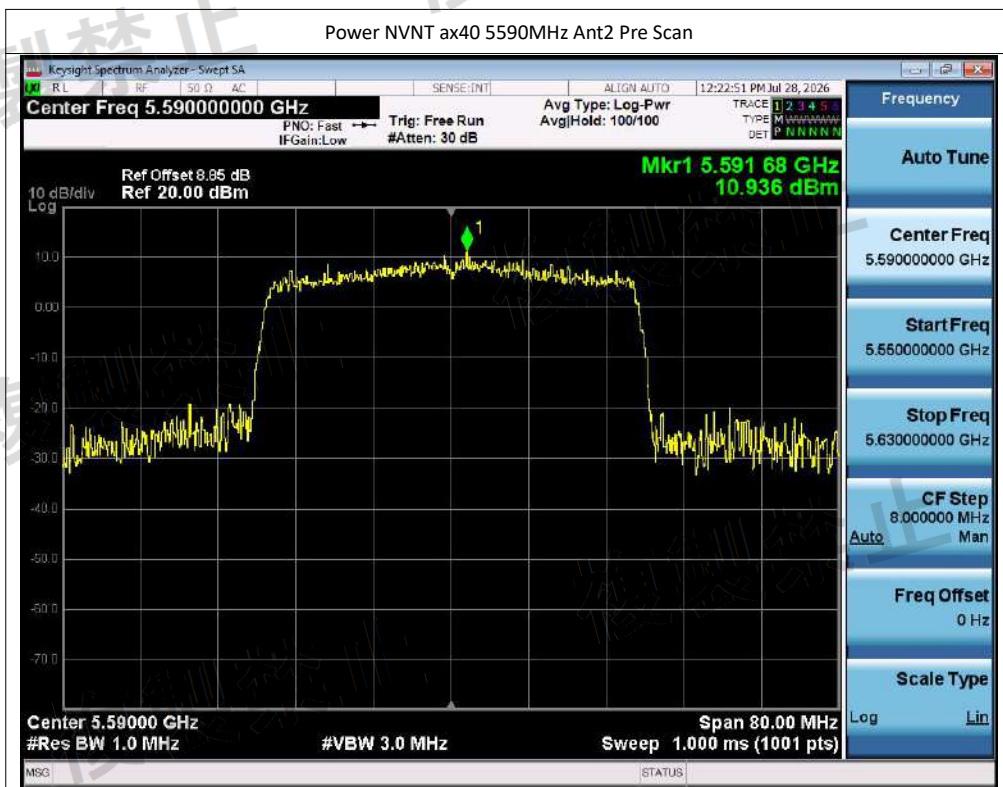

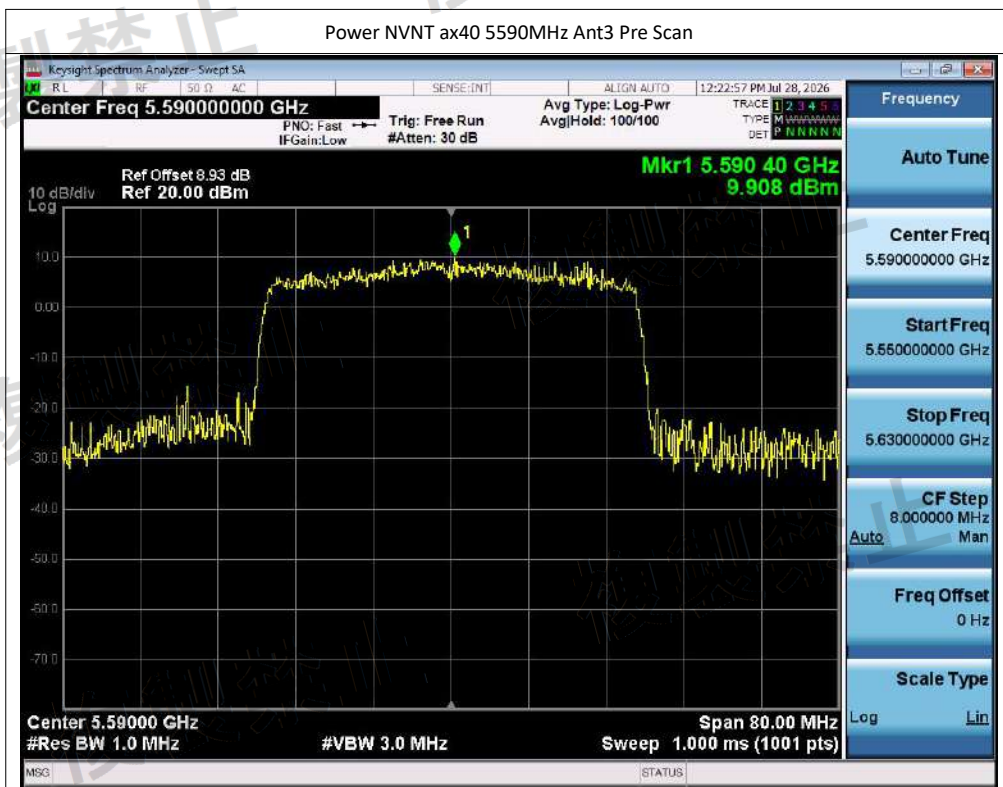

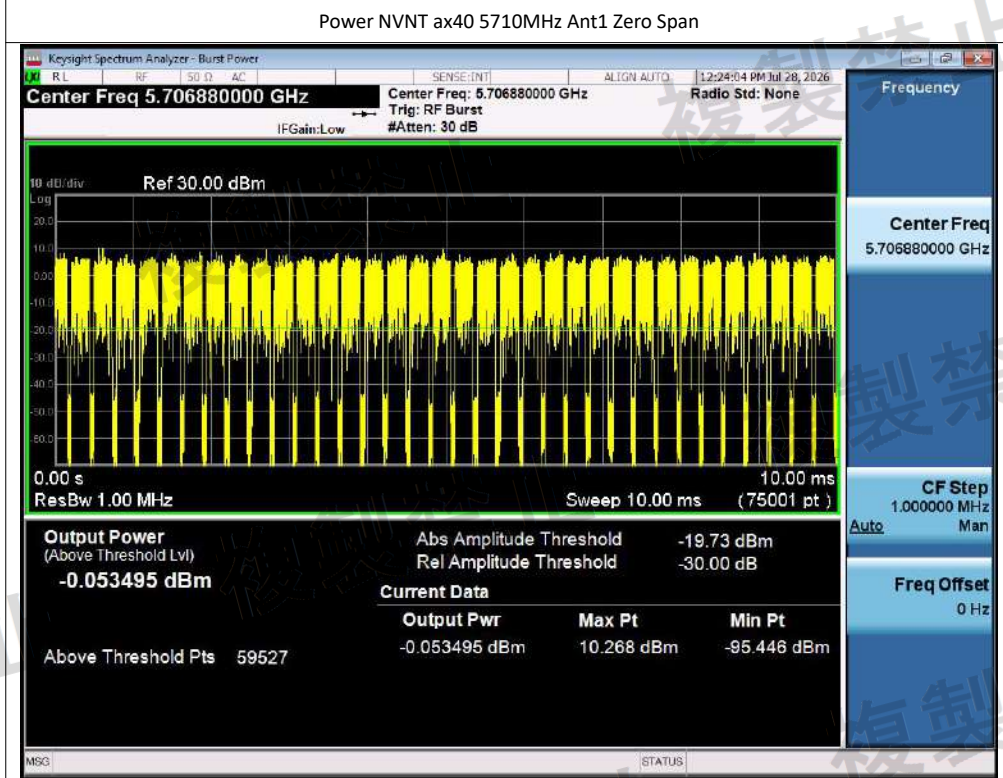

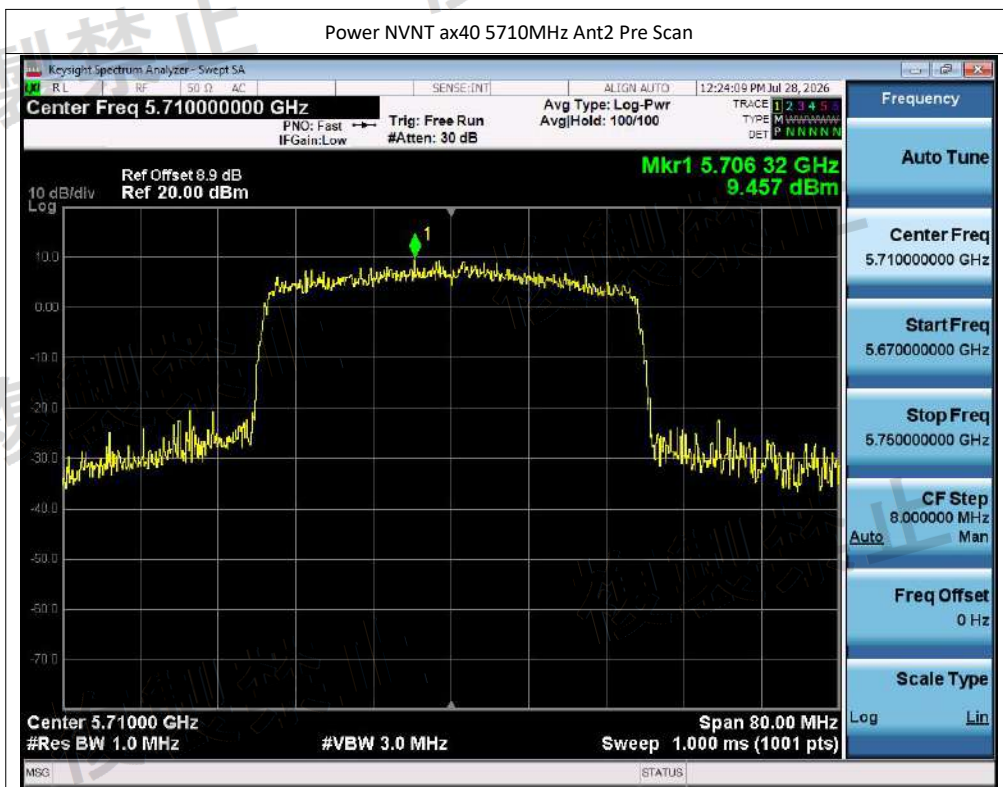


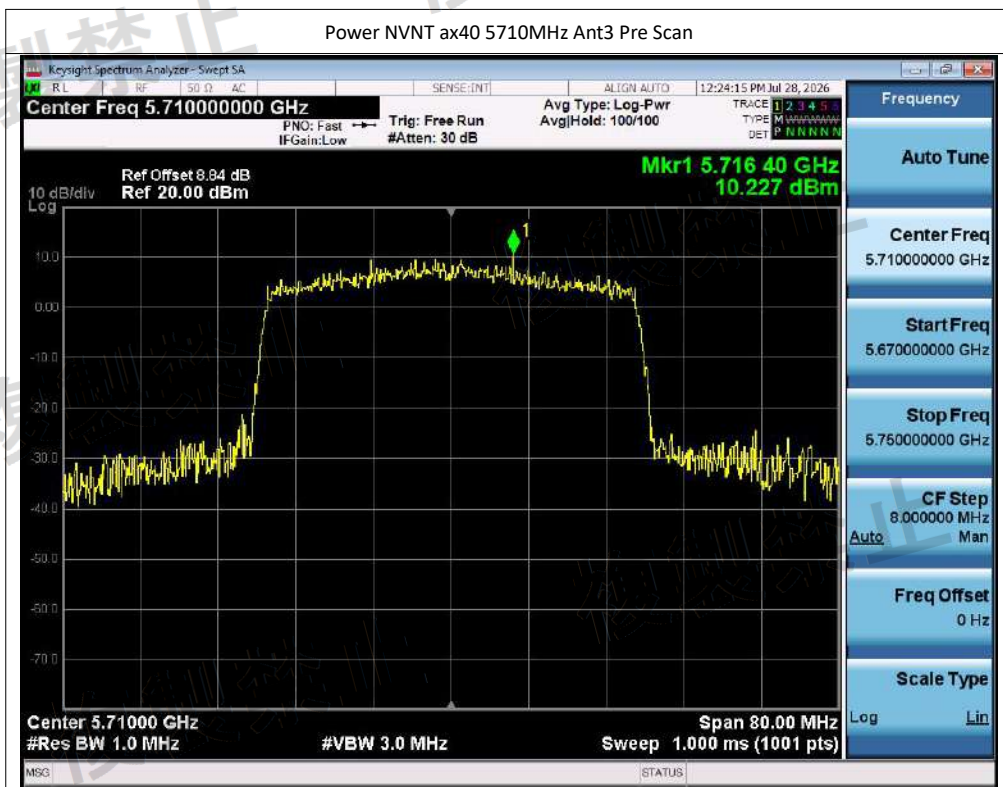











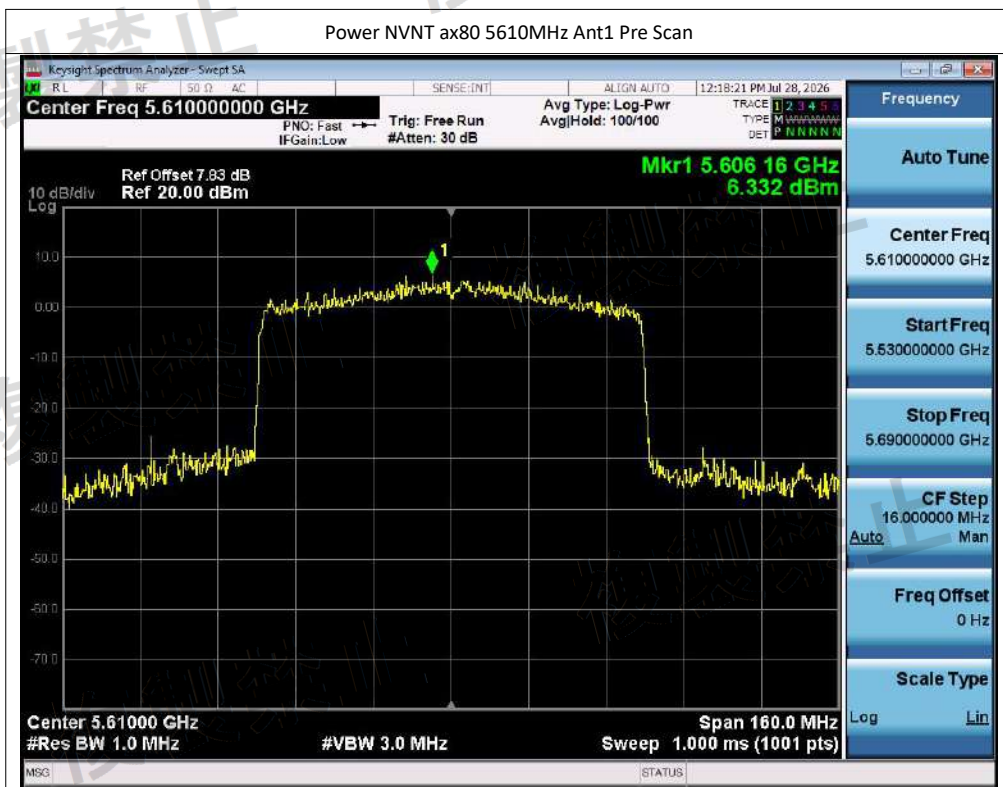


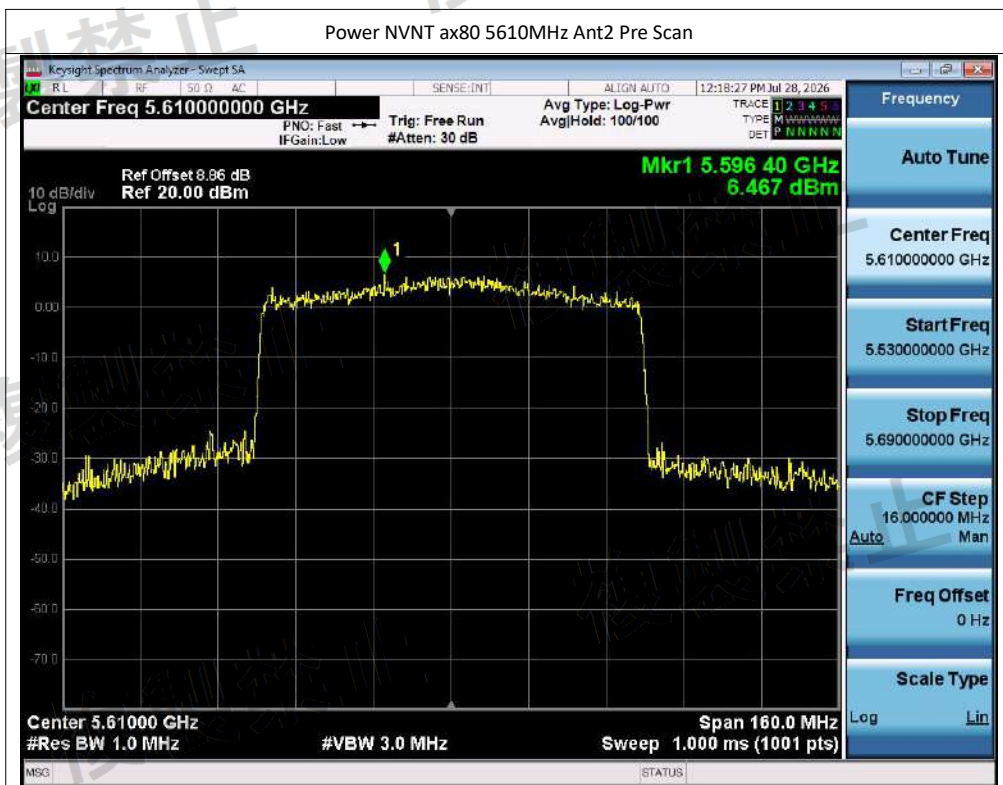


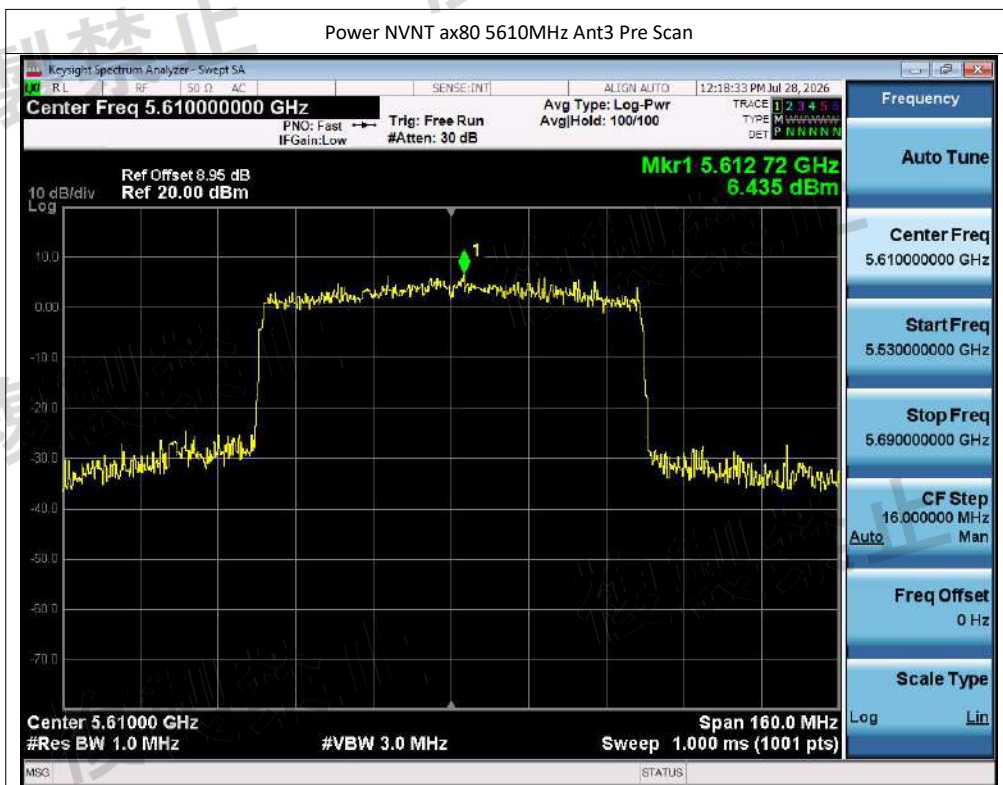

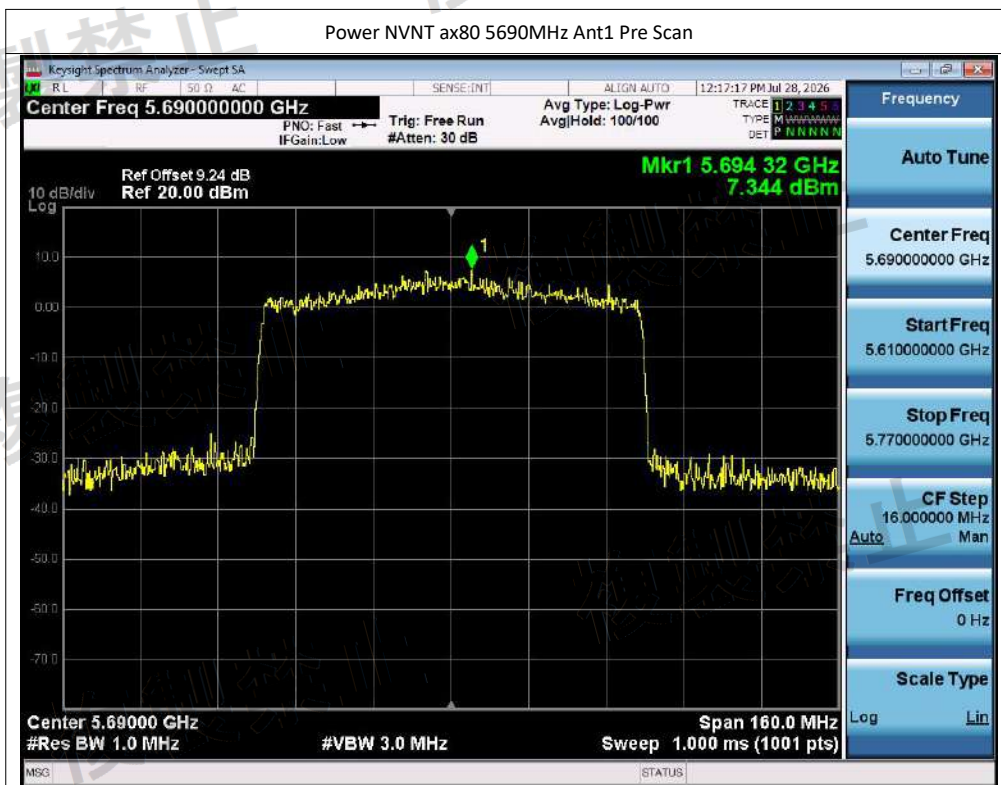


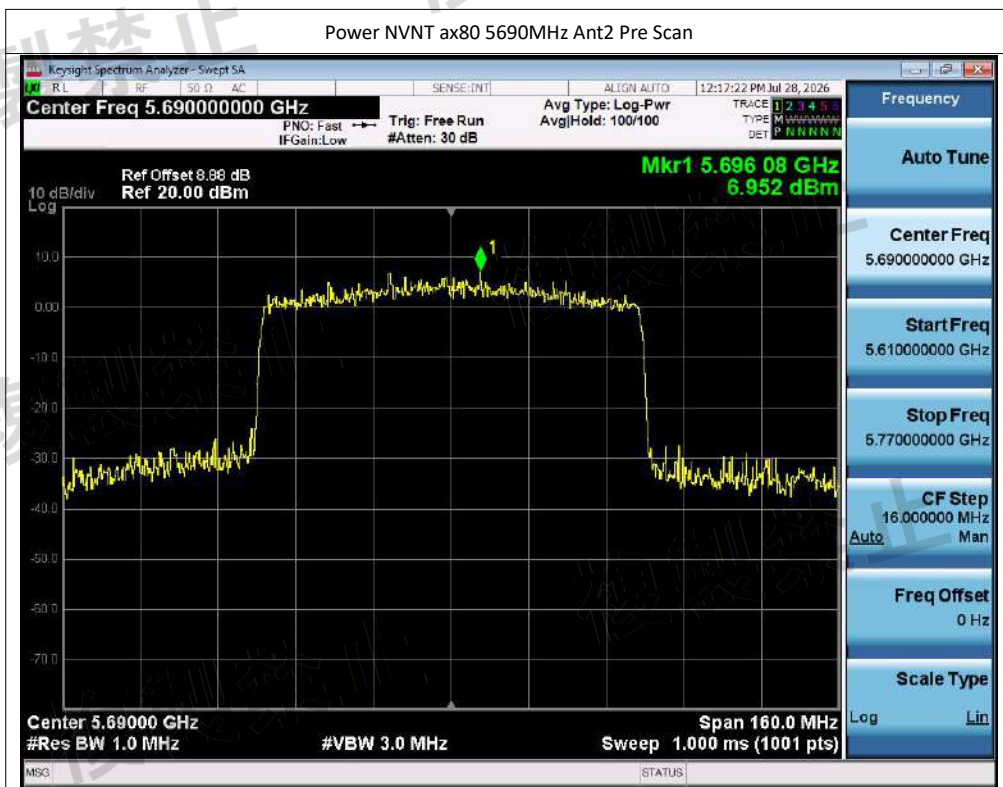


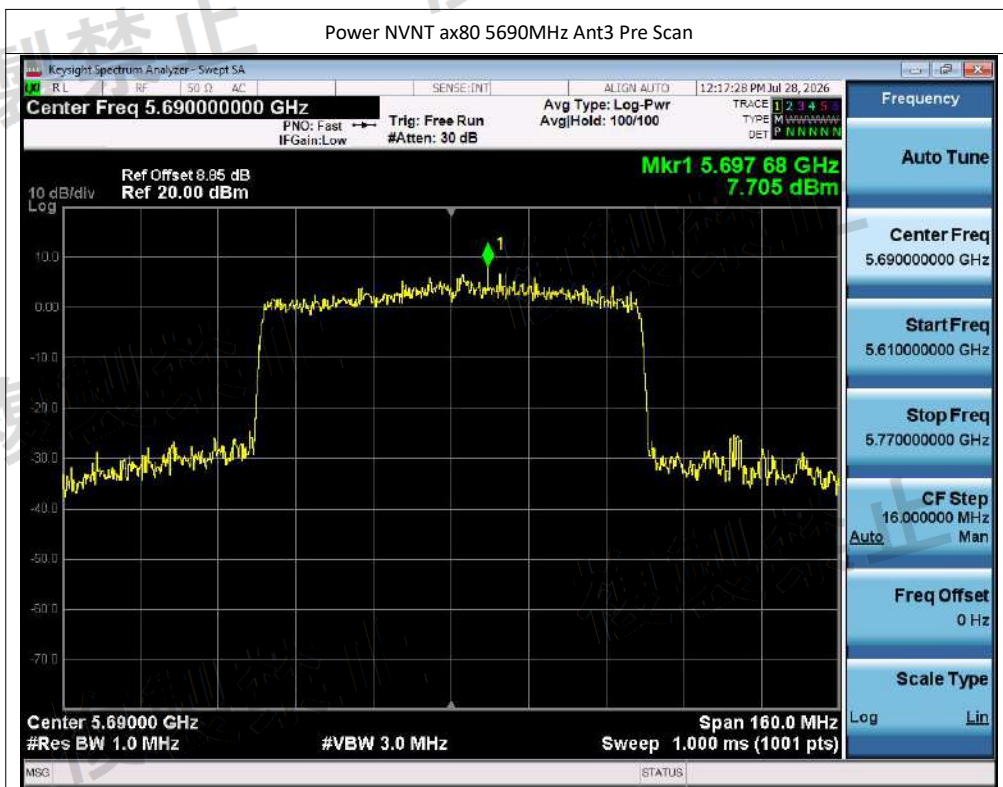

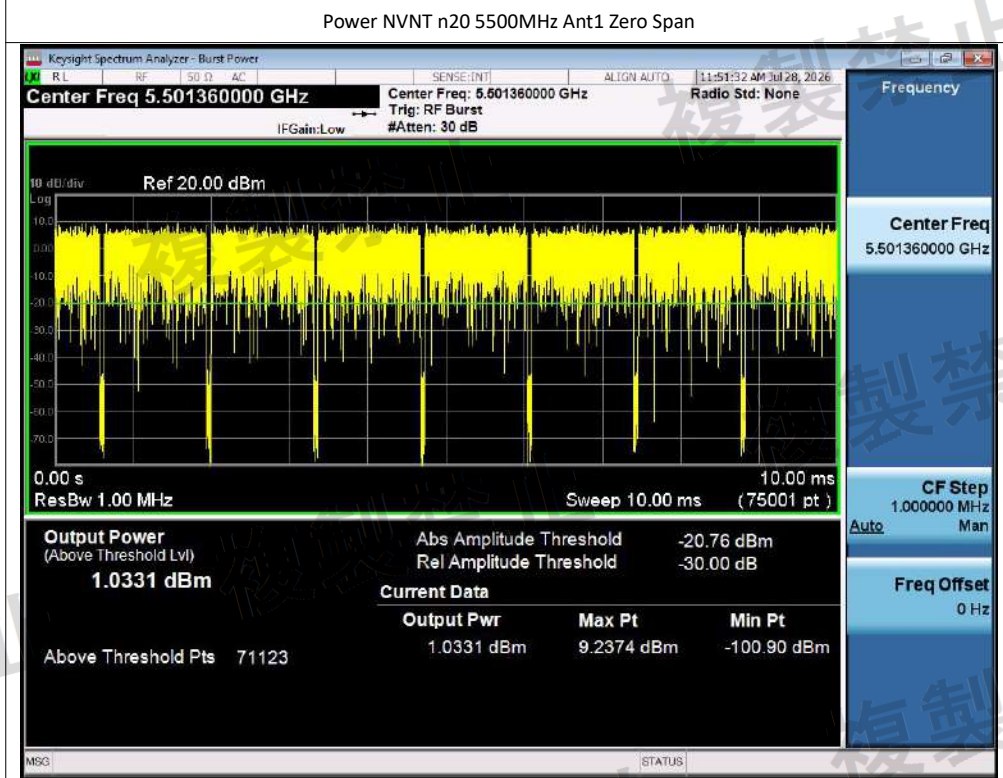



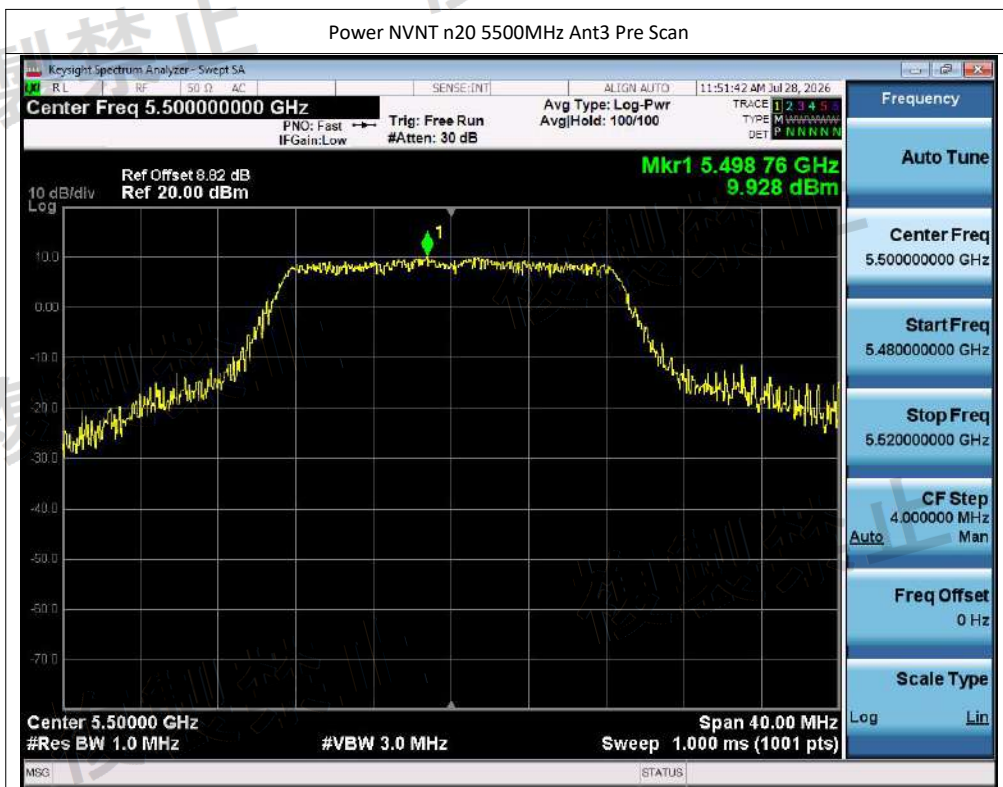


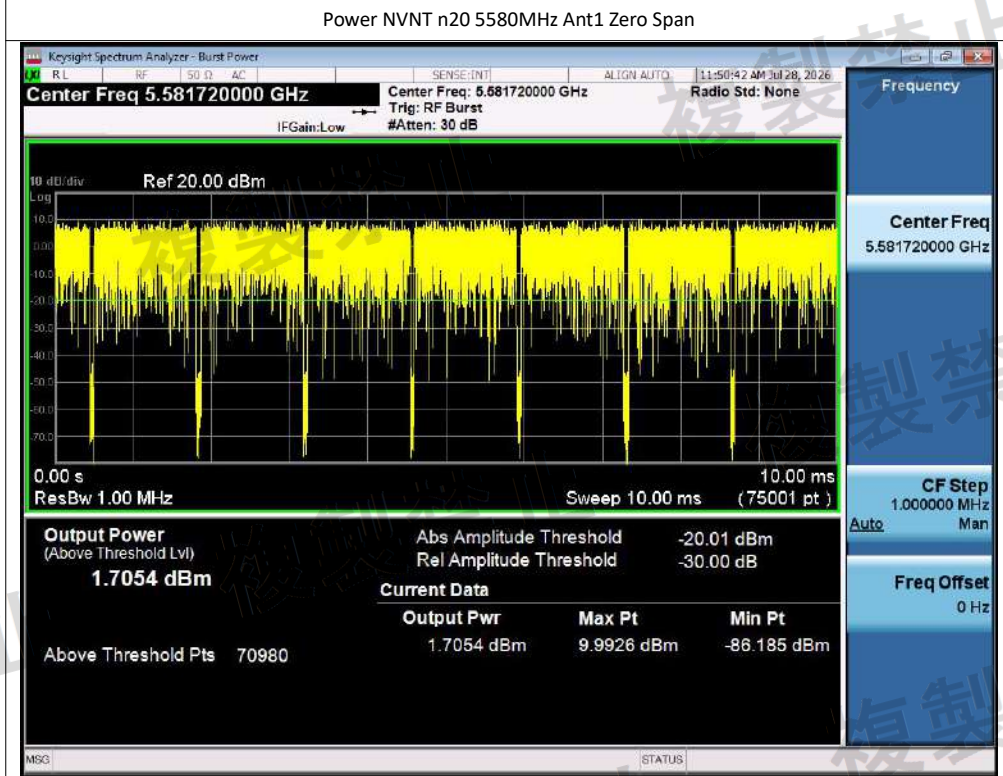









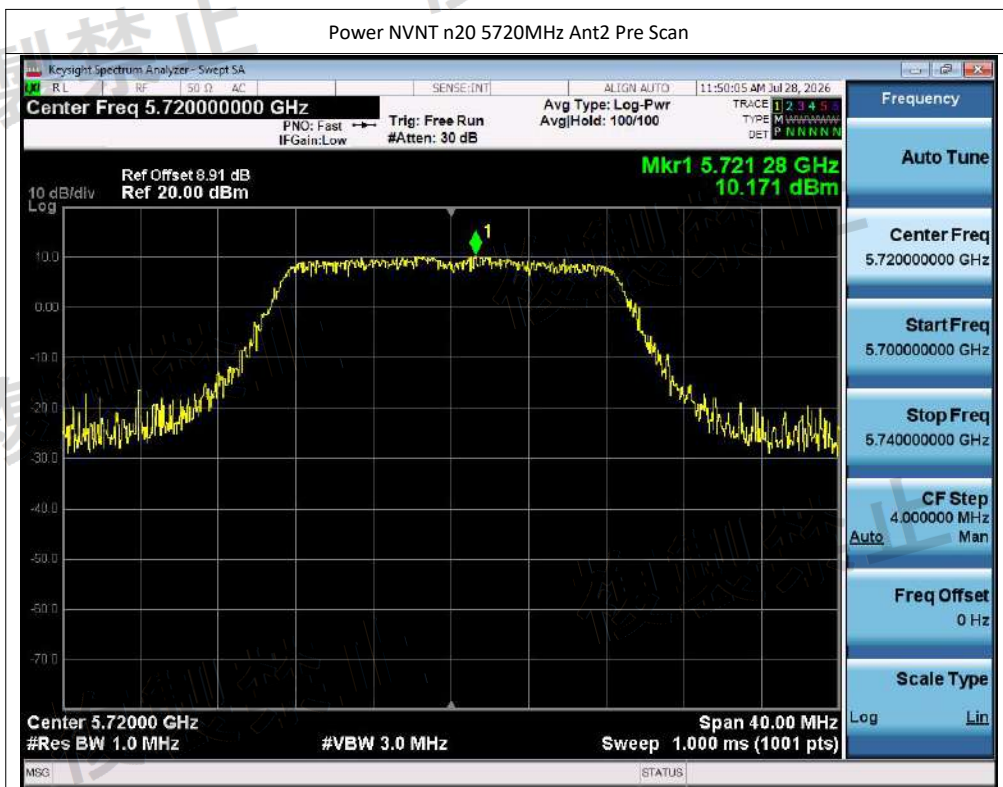





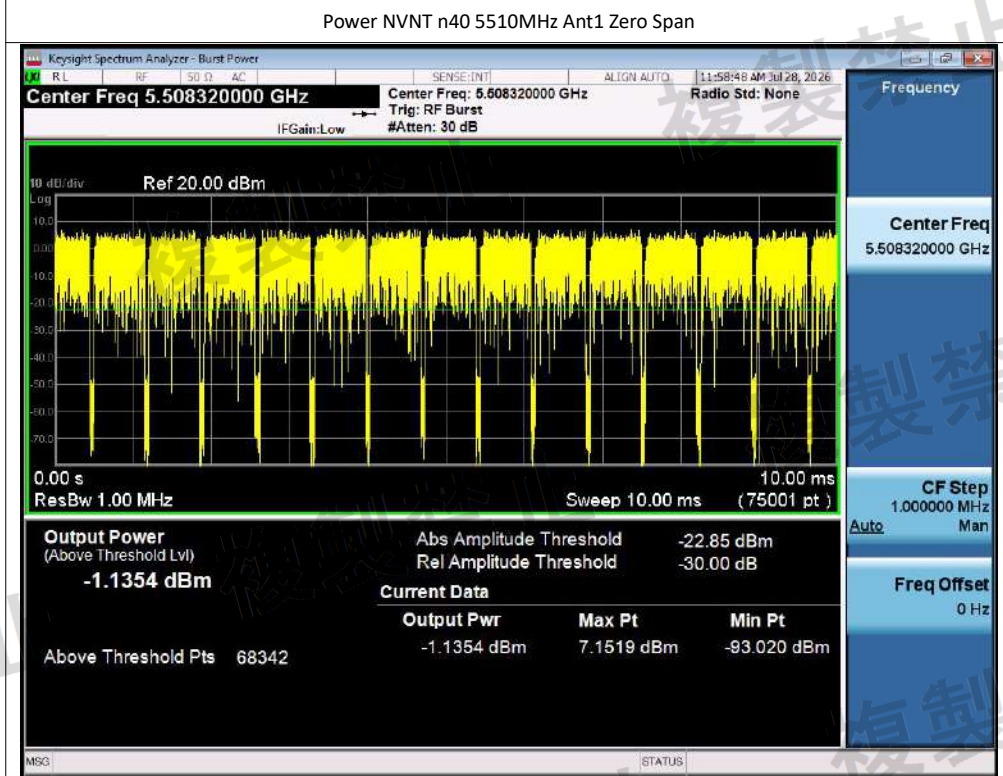




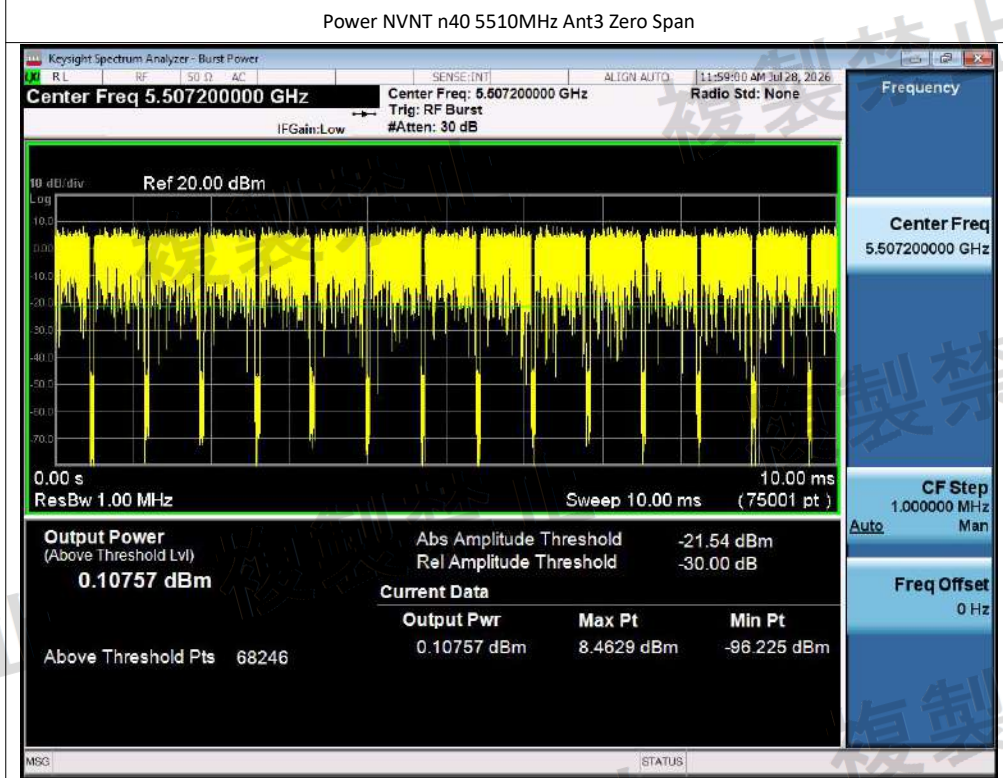

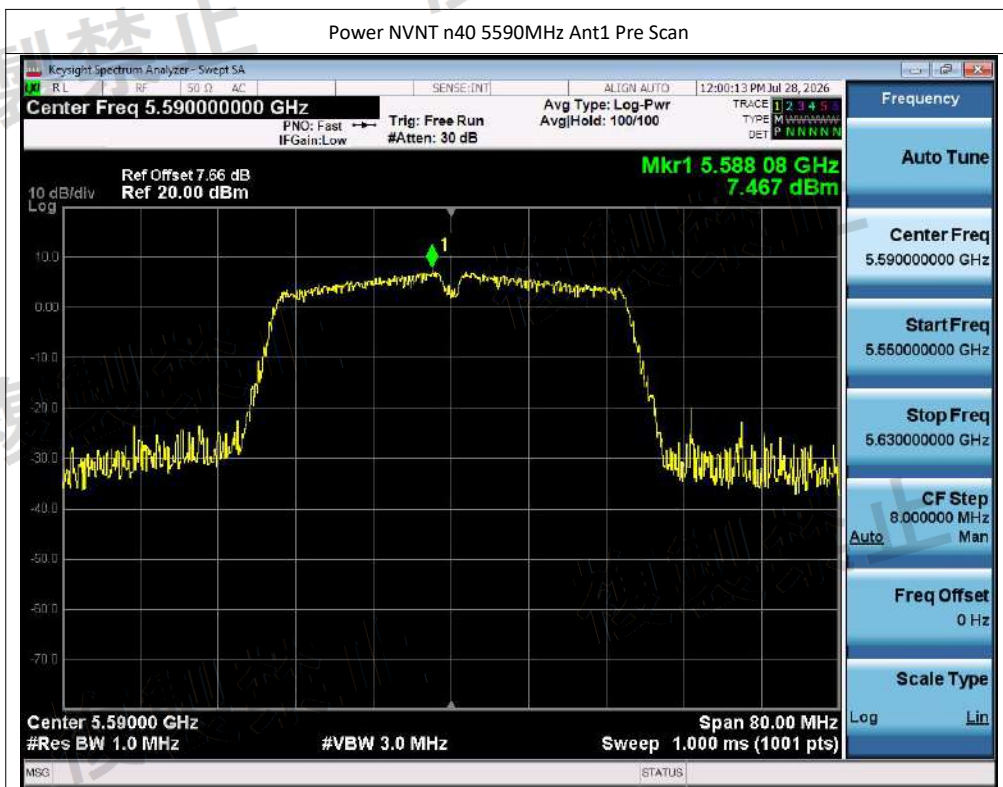


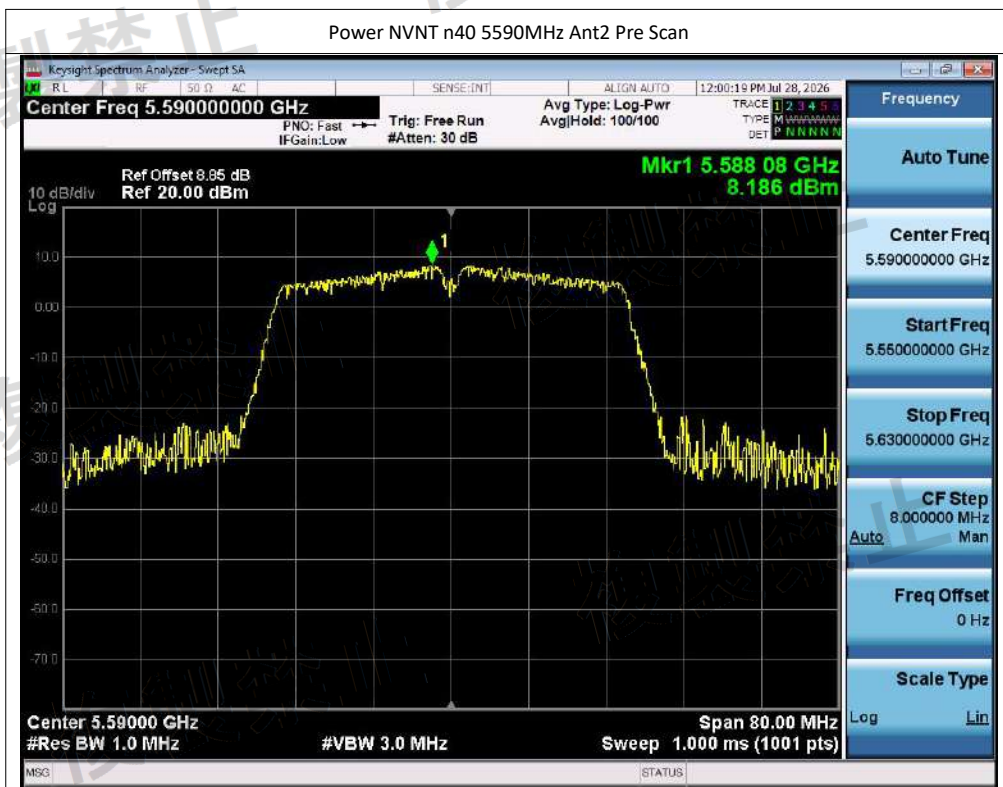



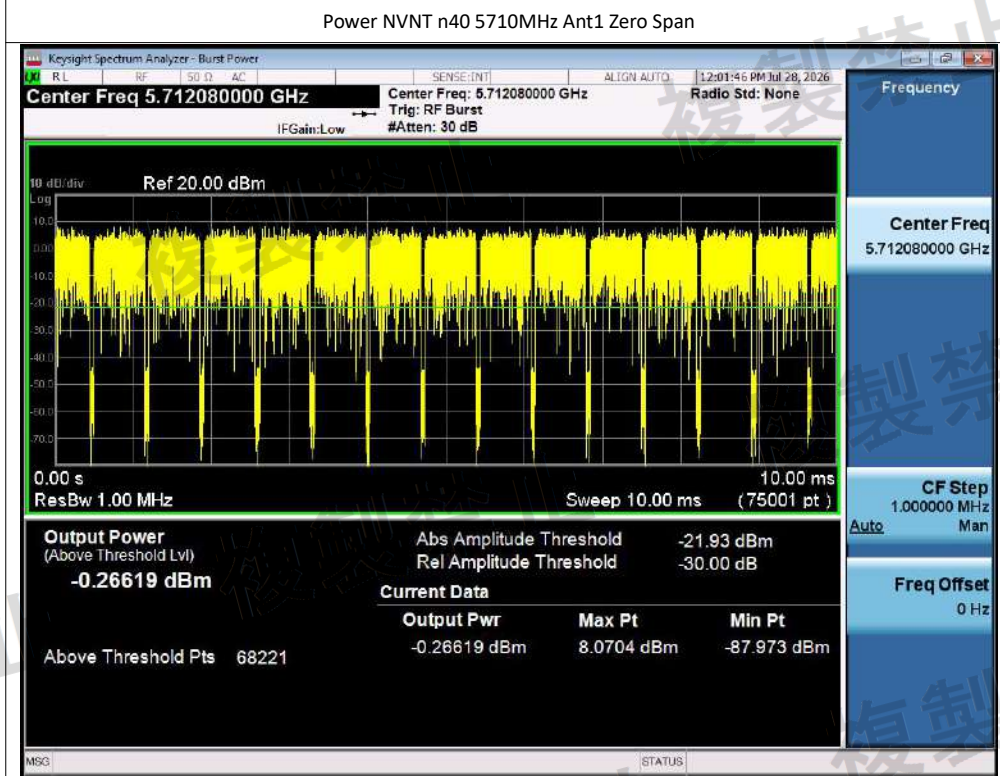



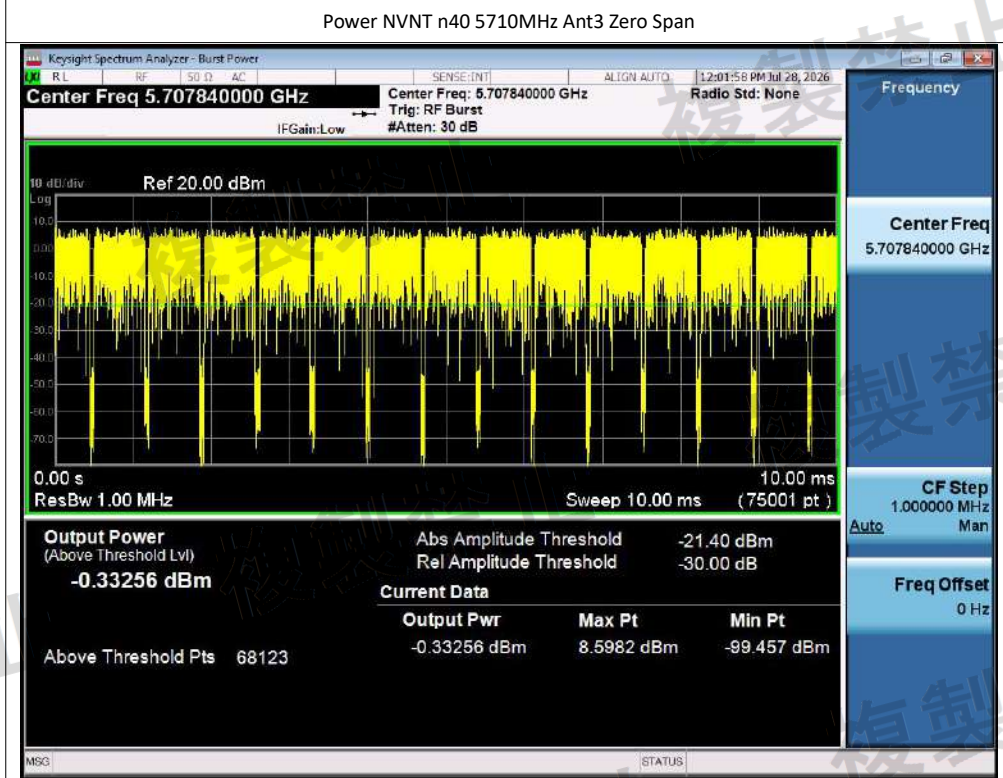

EIRP Power

Condition	Mode	Frequency (MHz)	Antenna	Power (dBm/MHz)	Power (mW/MHz)	Gain (dBi)	EIRP (dBm/MHz)	EIRP (mW/MHz)	Limit (mW/MHz)	Verdict
NVNT	a	5500	Ant1	5.26	3.357	6.47	11.73	14.894	25	Pass
NVNT	a	5580	Ant1	4.95	3.126	6.47	11.42	13.868	25	Pass
NVNT	a	5720	Ant1	4.86	3.062	6.47	11.33	13.583	25	Pass
NVNT	a	5500	Ant2	6.91	4.909	6.17	13.08	20.324	25	Pass
NVNT	a	5580	Ant2	6.43	4.395	6.17	12.6	18.197	25	Pass
NVNT	a	5720	Ant2	6.06	4.036	6.17	12.23	16.711	25	Pass
NVNT	a	5500	Ant3	6.8	4.786	6.22	13.02	20.045	25	Pass
NVNT	a	5580	Ant3	6.49	4.457	6.22	12.71	18.664	25	Pass
NVNT	a	5720	Ant3	6.19	4.159	6.22	12.41	17.418	25	Pass
NVNT	ac20	5500	Ant1	1.84	1.528	6.47	8.31	6.776	25	Pass
NVNT	ac20	5500	Ant2	2.82	1.914	6.17	8.99	7.925	25	Pass
NVNT	ac20	5500	Ant3	2.98	1.986	6.22	9.2	8.318	25	Pass
NVNT	ac20	5500	Sum	7.35	5.428	NaN	13.56	22.715	25	Pass
NVNT	ac20	5580	Ant1	1.32	1.355	6.47	7.79	6.012	25	Pass
NVNT	ac20	5580	Ant2	2.76	1.888	6.17	8.93	7.816	25	Pass
NVNT	ac20	5580	Ant3	2.97	1.982	6.22	9.19	8.299	25	Pass
NVNT	ac20	5580	Sum	7.18	5.225	NaN	13.45	22.127	25	Pass
NVNT	ac20	5720	Ant1	2.86	1.932	6.47	9.33	8.570	25	Pass
NVNT	ac20	5720	Ant2	2.05	1.603	6.17	8.22	6.637	25	Pass
NVNT	ac20	5720	Ant3	2.38	1.73	6.22	8.6	7.244	25	Pass
NVNT	ac20	5720	Sum	7.21	5.265	NaN	13.51	22.452	25	Pass
NVNT	ac40	5510	Ant1	-1.22	0.755	6.47	5.25	3.350	12.5	Pass
NVNT	ac40	5510	Ant2	0.08	1.019	6.17	6.25	4.217	12.5	Pass
NVNT	ac40	5510	Ant3	0.45	1.109	6.22	6.67	4.645	12.5	Pass
NVNT	ac40	5510	Sum	4.60	2.883	NaN	10.87	12.212	12.5	Pass
NVNT	ac40	5590	Ant1	-0.49	0.893	6.47	5.98	3.963	12.5	Pass
NVNT	ac40	5590	Ant2	0.55	1.135	6.17	6.72	4.699	12.5	Pass
NVNT	ac40	5590	Ant3	-0.18	0.959	6.22	6.04	4.018	12.5	Pass
NVNT	ac40	5590	Sum	4.75	2.987	NaN	11.03	12.680	12.5	Pass
NVNT	ac40	5710	Ant1	0.3	1.072	6.47	6.77	4.753	12.5	Pass
NVNT	ac40	5710	Ant2	-0.41	0.91	6.17	5.76	3.767	12.5	Pass
NVNT	ac40	5710	Ant3	-0.53	0.885	6.22	5.69	3.707	12.5	Pass
NVNT	ac40	5710	Sum	4.57	2.867	NaN	10.87	12.227	12.5	Pass
NVNT	ac80	5530	Ant1	-4.27	0.374	6.47	2.2	1.660	6.25	Pass
NVNT	ac80	5530	Ant2	-3.73	0.424	6.17	2.44	1.754	6.25	Pass
NVNT	ac80	5530	Ant3	-4.04	0.394	6.22	2.18	1.652	6.25	Pass
NVNT	ac80	5530	Sum	0.76	1.192	NaN	7.05	5.065	6.25	Pass
NVNT	ac80	5610	Ant1	-3.23	0.475	6.47	3.24	2.109	6.25	Pass

NVNT	ac80	5610	Ant2	-3.24	0.474	6.17	2.93	1.963	6.25	Pass
NVNT	ac80	5610	Ant3	-3.37	0.46	6.22	2.85	1.928	6.25	Pass
NVNT	ac80	5610	Sum	1.49	1.409	NaN	7.78	6.000	6.25	Pass
NVNT	ac80	5690	Ant1	-3.31	0.467	6.47	3.16	2.070	6.25	Pass
NVNT	ac80	5690	Ant2	-3.26	0.472	6.17	2.91	1.954	6.25	Pass
NVNT	ac80	5690	Ant3	-5.77	0.265	6.22	0.45	1.109	6.25	Pass
NVNT	ac80	5690	Sum	0.81	1.204	NaN	7.10	5.134	6.25	Pass
NVNT	ax20	5500	Ant1	1.28	1.343	6.47	7.75	5.957	25	Pass
NVNT	ax20	5500	Ant2	2.48	1.77	6.17	8.65	7.328	25	Pass
NVNT	ax20	5500	Ant3	2.07	1.611	6.22	8.29	6.745	25	Pass
NVNT	ax20	5500	Sum	6.74	4.724	NaN	13.02	20.030	25	Pass
NVNT	ax20	5580	Ant1	1.51	1.416	6.47	7.98	6.281	25	Pass
NVNT	ax20	5580	Ant2	2.05	1.603	6.17	8.22	6.637	25	Pass
NVNT	ax20	5580	Ant3	2.59	1.816	6.22	8.81	7.603	25	Pass
NVNT	ax20	5580	Sum	6.84	4.835	NaN	13.12	20.521	25	Pass
NVNT	ax20	5720	Ant1	1.8	1.514	6.47	8.27	6.714	25	Pass
NVNT	ax20	5720	Ant2	2.36	1.722	6.17	8.53	7.129	25	Pass
NVNT	ax20	5720	Ant3	2.03	1.596	6.22	8.25	6.683	25	Pass
NVNT	ax20	5720	Sum	6.84	4.832	NaN	13.12	20.526	25	Pass
NVNT	ax40	5510	Ant1	-2.03	0.627	6.47	4.44	2.780	12.5	Pass
NVNT	ax40	5510	Ant2	0.1	1.023	6.17	6.27	4.236	12.5	Pass
NVNT	ax40	5510	Ant3	0.42	1.102	6.22	6.64	4.613	12.5	Pass
NVNT	ax40	5510	Sum	4.40	2.752	NaN	10.66	11.629	12.5	Pass
NVNT	ax40	5590	Ant1	-1.24	0.752	6.47	5.23	3.334	12.5	Pass
NVNT	ax40	5590	Ant2	0.54	1.132	6.17	6.71	4.688	12.5	Pass
NVNT	ax40	5590	Ant3	-0.71	0.849	6.22	5.51	3.556	12.5	Pass
NVNT	ax40	5590	Sum	4.37	2.733	NaN	10.64	11.579	12.5	Pass
NVNT	ax40	5710	Ant1	-0.05	0.989	6.47	6.42	4.385	12.5	Pass
NVNT	ax40	5710	Ant2	-0.57	0.877	6.17	5.6	3.631	12.5	Pass
NVNT	ax40	5710	Ant3	-1.16	0.766	6.22	5.06	3.206	12.5	Pass
NVNT	ax40	5710	Sum	4.20	2.632	NaN	10.50	11.222	12.5	Pass
NVNT	ax80	5530	Ant1	-4.92	0.322	6.47	1.55	1.429	6.25	Pass
NVNT	ax80	5530	Ant2	-3.73	0.424	6.17	2.44	1.754	6.25	Pass
NVNT	ax80	5530	Ant3	-3.35	0.462	6.22	2.87	1.936	6.25	Pass
NVNT	ax80	5530	Sum	0.82	1.208	NaN	7.09	5.119	6.25	Pass
NVNT	ax80	5610	Ant1	-3.33	0.465	6.47	3.14	2.061	6.25	Pass
NVNT	ax80	5610	Ant2	-3.83	0.414	6.17	2.34	1.714	6.25	Pass
NVNT	ax80	5610	Ant3	-2.74	0.532	6.22	3.48	2.228	6.25	Pass
NVNT	ax80	5610	Sum	1.50	1.411	NaN	7.78	6.003	6.25	Pass
NVNT	ax80	5690	Ant1	-3.1	0.49	6.47	3.37	2.173	6.25	Pass
NVNT	ax80	5690	Ant2	-3.51	0.446	6.17	2.66	1.845	6.25	Pass
NVNT	ax80	5690	Ant3	-3.6	0.437	6.22	2.62	1.828	6.25	Pass

NVNT	ax80	5690	Sum	1.38	1.373	NaN	7.67	5.846	6.25	Pass
NVNT	n20	5500	Ant1	1.03	1.268	6.47	7.5	5.623	25	Pass
NVNT	n20	5500	Ant2	2.33	1.71	6.17	8.5	7.079	25	Pass
NVNT	n20	5500	Ant3	2.34	1.714	6.22	8.56	7.178	25	Pass
NVNT	n20	5500	Sum	6.71	4.692	NaN	12.98	19.881	25	Pass
NVNT	n20	5580	Ant1	1.71	1.483	6.47	8.18	6.577	25	Pass
NVNT	n20	5580	Ant2	3.11	2.046	6.17	9.28	8.472	25	Pass
NVNT	n20	5580	Ant3	2.94	1.968	6.22	9.16	8.241	25	Pass
NVNT	n20	5580	Sum	7.40	5.497	NaN	13.67	23.290	25	Pass
NVNT	n20	5720	Ant1	2.62	1.828	6.47	9.09	8.110	25	Pass
NVNT	n20	5720	Ant2	2.58	1.811	6.17	8.75	7.499	25	Pass
NVNT	n20	5720	Ant3	2.73	1.875	6.22	8.95	7.852	25	Pass
NVNT	n20	5720	Sum	7.41	5.514	NaN	13.70	23.461	25	Pass
NVNT	n40	5510	Ant1	-1.14	0.769	6.47	5.33	3.412	12.5	Pass
NVNT	n40	5510	Ant2	0.09	1.021	6.17	6.26	4.227	12.5	Pass
NVNT	n40	5510	Ant3	0.11	1.026	6.22	6.33	4.295	12.5	Pass
NVNT	n40	5510	Sum	4.50	2.816	NaN	10.77	11.934	12.5	Pass
NVNT	n40	5590	Ant1	-0.97	0.8	6.47	5.5	3.548	12.5	Pass
NVNT	n40	5590	Ant2	0.23	1.054	6.17	6.4	4.365	12.5	Pass
NVNT	n40	5590	Ant3	-0.03	0.993	6.22	6.19	4.159	12.5	Pass
NVNT	n40	5590	Sum	4.54	2.847	NaN	10.82	12.072	12.5	Pass
NVNT	n40	5710	Ant1	-0.27	0.94	6.47	6.2	4.169	12.5	Pass
NVNT	n40	5710	Ant2	-0.53	0.885	6.17	5.64	3.664	12.5	Pass
NVNT	n40	5710	Ant3	-0.33	0.927	6.22	5.89	3.882	12.5	Pass
NVNT	n40	5710	Sum	4.40	2.752	NaN	10.69	11.715	12.5	Pass

Occupied Channel Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	99% OBW (MHz)	Lower Limit (MHz)	Upper Limit (MHz)	Verdict
NVNT	a	5500	Ant1	16.556	N/A	20	Pass
NVNT	a	5580	Ant1	16.416	N/A	20	Pass
NVNT	a	5720	Ant1	16.415	N/A	20	Pass
NVNT	a	5500	Ant2	16.553	N/A	20	Pass
NVNT	a	5580	Ant2	16.416	N/A	20	Pass
NVNT	a	5720	Ant2	16.414	N/A	20	Pass
NVNT	a	5500	Ant3	16.562	N/A	20	Pass
NVNT	a	5580	Ant3	16.414	N/A	20	Pass
NVNT	a	5720	Ant3	16.414	N/A	20	Pass
NVNT	ac20	5500	Ant1	17.729	N/A	20	Pass
NVNT	ac20	5500	Ant2	17.746	N/A	20	Pass
NVNT	ac20	5500	Ant3	17.751	N/A	20	Pass
NVNT	ac20	5580	Ant1	17.61	N/A	20	Pass
NVNT	ac20	5580	Ant2	17.597	N/A	20	Pass
NVNT	ac20	5580	Ant3	17.6	N/A	20	Pass
NVNT	ac20	5720	Ant1	17.603	N/A	20	Pass
NVNT	ac20	5720	Ant2	17.598	N/A	20	Pass
NVNT	ac20	5720	Ant3	17.595	N/A	20	Pass
NVNT	ac40	5510	Ant1	36.039	N/A	40	Pass
NVNT	ac40	5510	Ant2	36.116	N/A	40	Pass
NVNT	ac40	5510	Ant3	36.043	N/A	40	Pass
NVNT	ac40	5590	Ant1	35.953	N/A	40	Pass
NVNT	ac40	5590	Ant2	35.957	N/A	40	Pass
NVNT	ac40	5590	Ant3	35.992	N/A	40	Pass
NVNT	ac40	5710	Ant1	35.792	N/A	40	Pass
NVNT	ac40	5710	Ant2	35.801	N/A	40	Pass
NVNT	ac40	5710	Ant3	35.728	N/A	40	Pass
NVNT	ac80	5530	Ant1	75.331	N/A	80	Pass
NVNT	ac80	5530	Ant2	75.398	N/A	80	Pass
NVNT	ac80	5530	Ant3	75.416	N/A	80	Pass
NVNT	ac80	5610	Ant1	75.161	N/A	80	Pass
NVNT	ac80	5610	Ant2	75.206	N/A	80	Pass
NVNT	ac80	5610	Ant3	75.133	N/A	80	Pass
NVNT	ac80	5690	Ant1	75.098	N/A	80	Pass
NVNT	ac80	5690	Ant2	75.062	N/A	80	Pass
NVNT	ac80	5690	Ant3	75.049	N/A	80	Pass
NVNT	ax20	5500	Ant1	19.022	N/A	20	Pass
NVNT	ax20	5500	Ant2	19.019	N/A	20	Pass
NVNT	ax20	5500	Ant3	19.026	N/A	20	Pass

NVNT	ax20	5580	Ant1	18.953	N/A	20	Pass
NVNT	ax20	5580	Ant2	18.939	N/A	20	Pass
NVNT	ax20	5580	Ant3	18.922	N/A	20	Pass
NVNT	ax20	5720	Ant1	18.947	N/A	20	Pass
NVNT	ax20	5720	Ant2	18.942	N/A	20	Pass
NVNT	ax20	5720	Ant3	18.936	N/A	20	Pass
NVNT	ax40	5510	Ant1	37.609	N/A	40	Pass
NVNT	ax40	5510	Ant2	37.664	N/A	40	Pass
NVNT	ax40	5510	Ant3	37.623	N/A	40	Pass
NVNT	ax40	5590	Ant1	37.574	N/A	40	Pass
NVNT	ax40	5590	Ant2	37.596	N/A	40	Pass
NVNT	ax40	5590	Ant3	37.623	N/A	40	Pass
NVNT	ax40	5710	Ant1	37.468	N/A	40	Pass
NVNT	ax40	5710	Ant2	37.482	N/A	40	Pass
NVNT	ax40	5710	Ant3	37.425	N/A	40	Pass
NVNT	ax80	5530	Ant1	76.935	N/A	80	Pass
NVNT	ax80	5530	Ant2	76.893	N/A	80	Pass
NVNT	ax80	5530	Ant3	76.952	N/A	80	Pass
NVNT	ax80	5610	Ant1	76.713	N/A	80	Pass
NVNT	ax80	5610	Ant2	76.753	N/A	80	Pass
NVNT	ax80	5610	Ant3	76.555	N/A	80	Pass
NVNT	ax80	5690	Ant1	76.548	N/A	80	Pass
NVNT	ax80	5690	Ant2	76.474	N/A	80	Pass
NVNT	ax80	5690	Ant3	76.369	N/A	80	Pass
NVNT	n20	5500	Ant1	17.739	N/A	20	Pass
NVNT	n20	5500	Ant2	17.749	N/A	20	Pass
NVNT	n20	5500	Ant3	17.758	N/A	20	Pass
NVNT	n20	5580	Ant1	17.627	N/A	20	Pass
NVNT	n20	5580	Ant2	17.616	N/A	20	Pass
NVNT	n20	5580	Ant3	17.613	N/A	20	Pass
NVNT	n20	5720	Ant1	17.613	N/A	20	Pass
NVNT	n20	5720	Ant2	17.61	N/A	20	Pass
NVNT	n20	5720	Ant3	17.61	N/A	20	Pass
NVNT	n40	5510	Ant1	36.004	N/A	40	Pass
NVNT	n40	5510	Ant2	36.046	N/A	40	Pass
NVNT	n40	5510	Ant3	36	N/A	40	Pass
NVNT	n40	5590	Ant1	35.943	N/A	40	Pass
NVNT	n40	5590	Ant2	35.953	N/A	40	Pass
NVNT	n40	5590	Ant3	35.967	N/A	40	Pass
NVNT	n40	5710	Ant1	35.829	N/A	40	Pass
NVNT	n40	5710	Ant2	35.803	N/A	40	Pass
NVNT	n40	5710	Ant3	35.735	N/A	40	Pass


Test Graphs


OBW NVNT a 5500MHz Ant1




OBW NVNT a 5580MHz Ant1



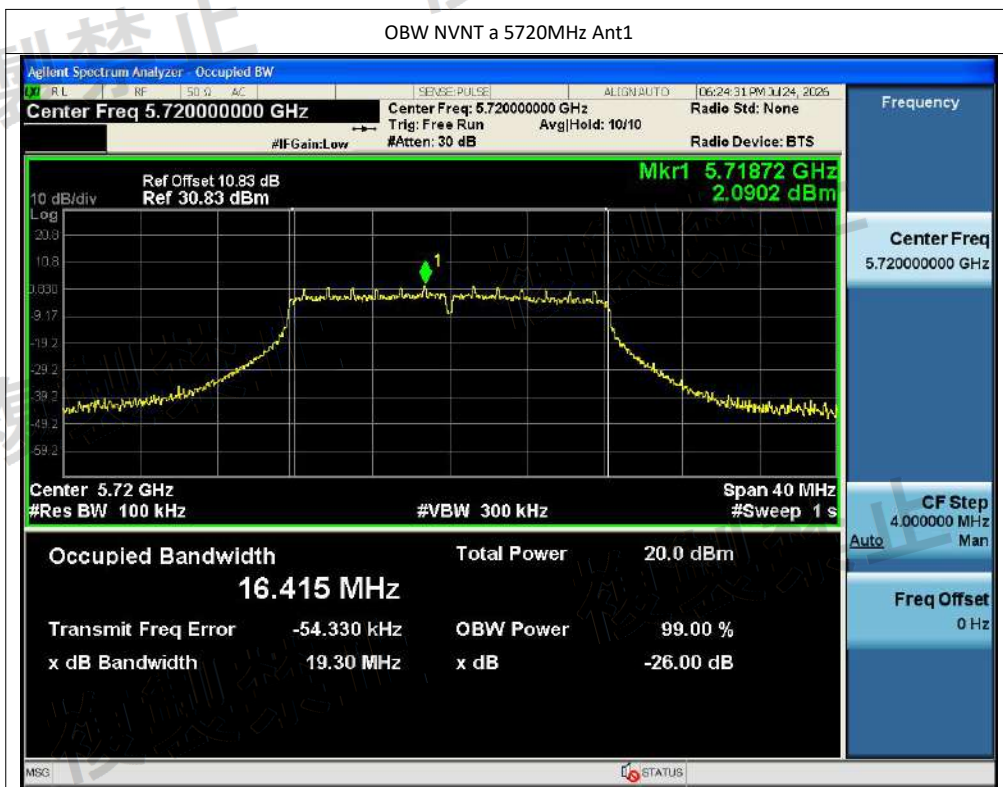

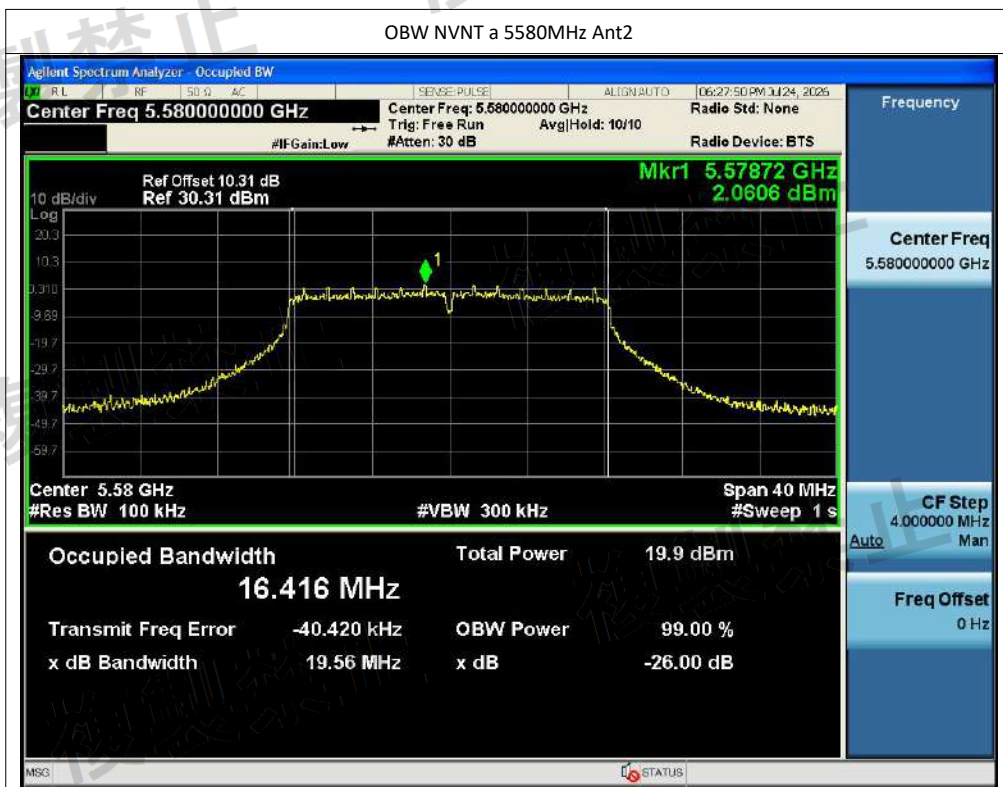




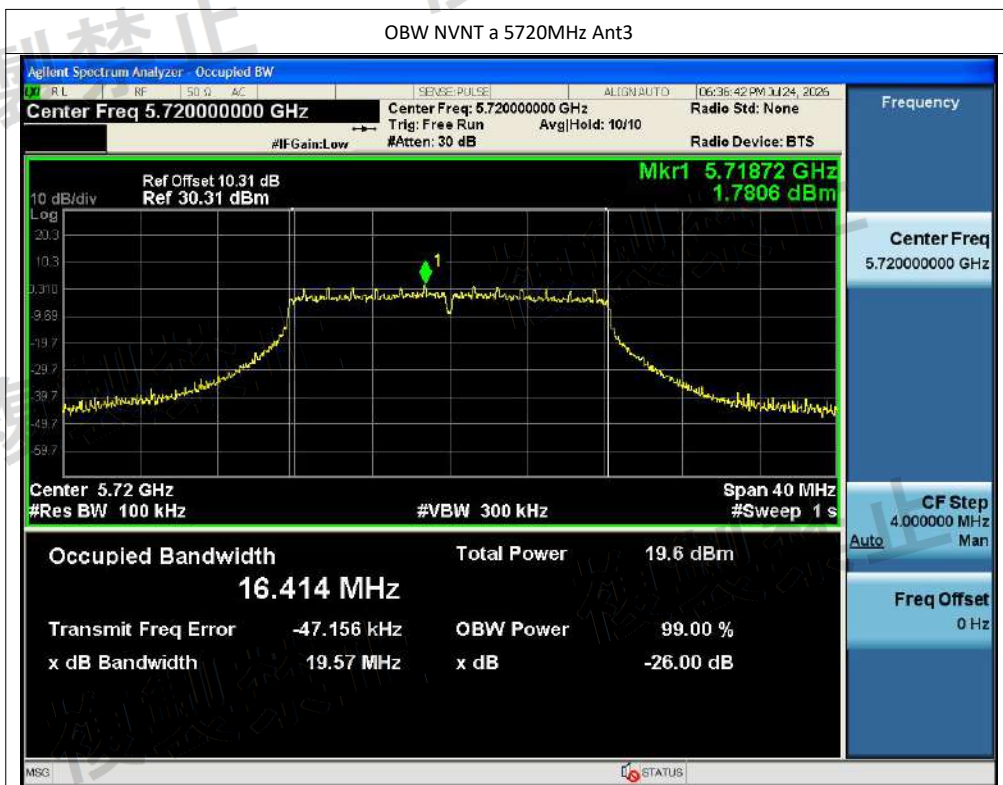





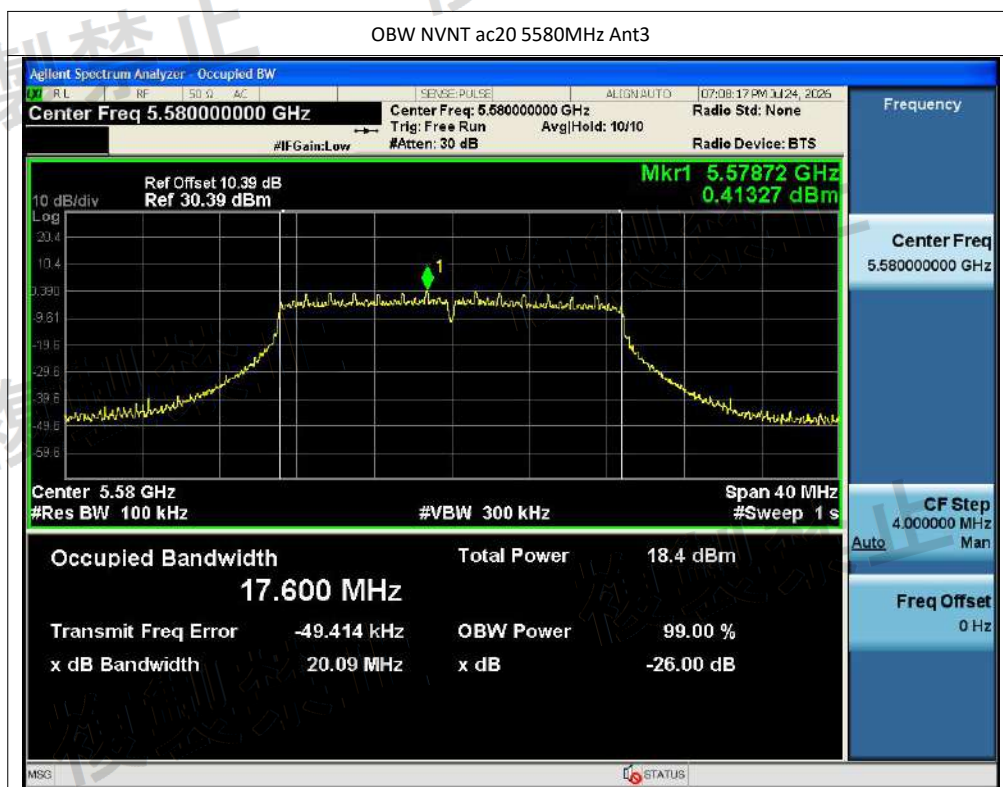











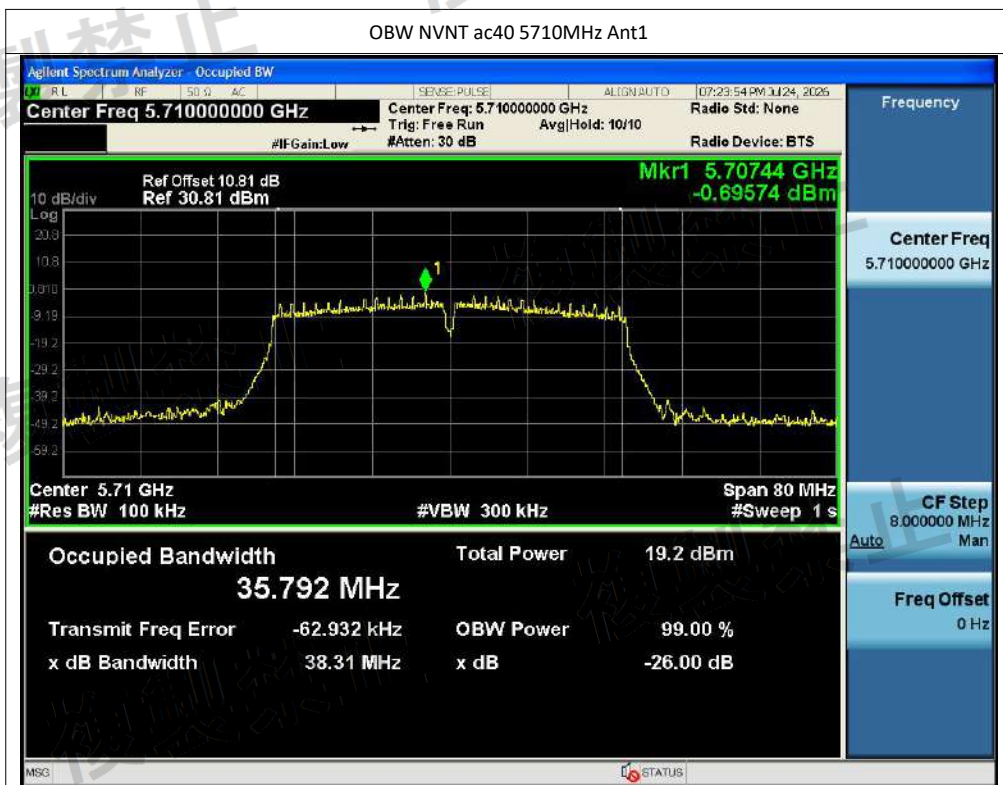






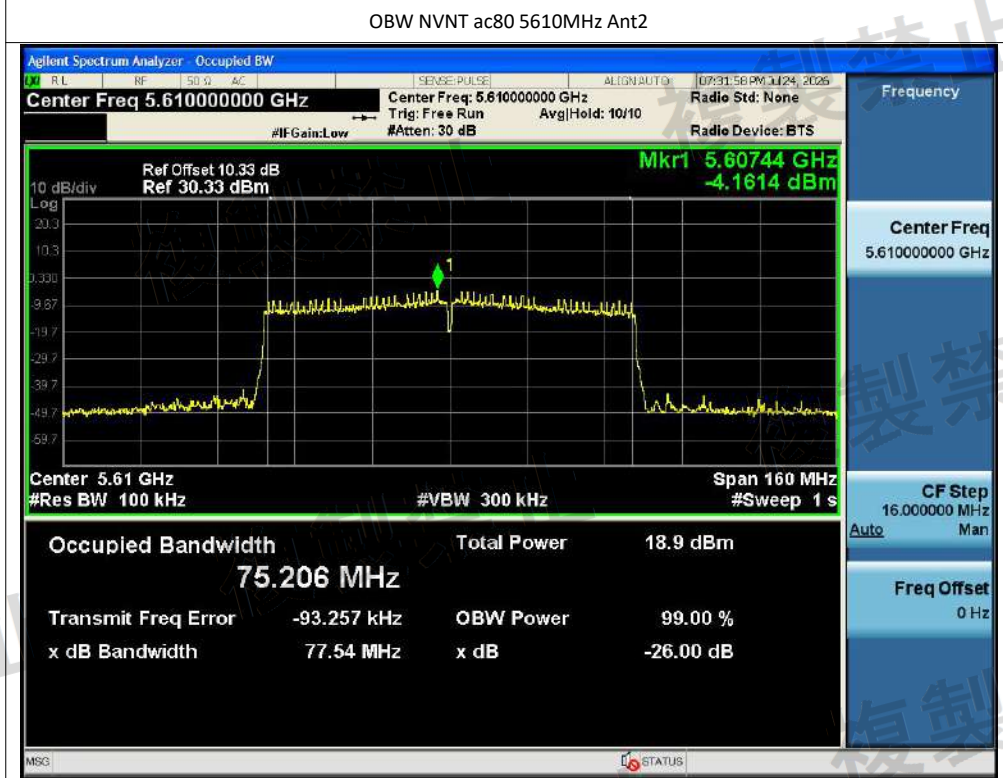



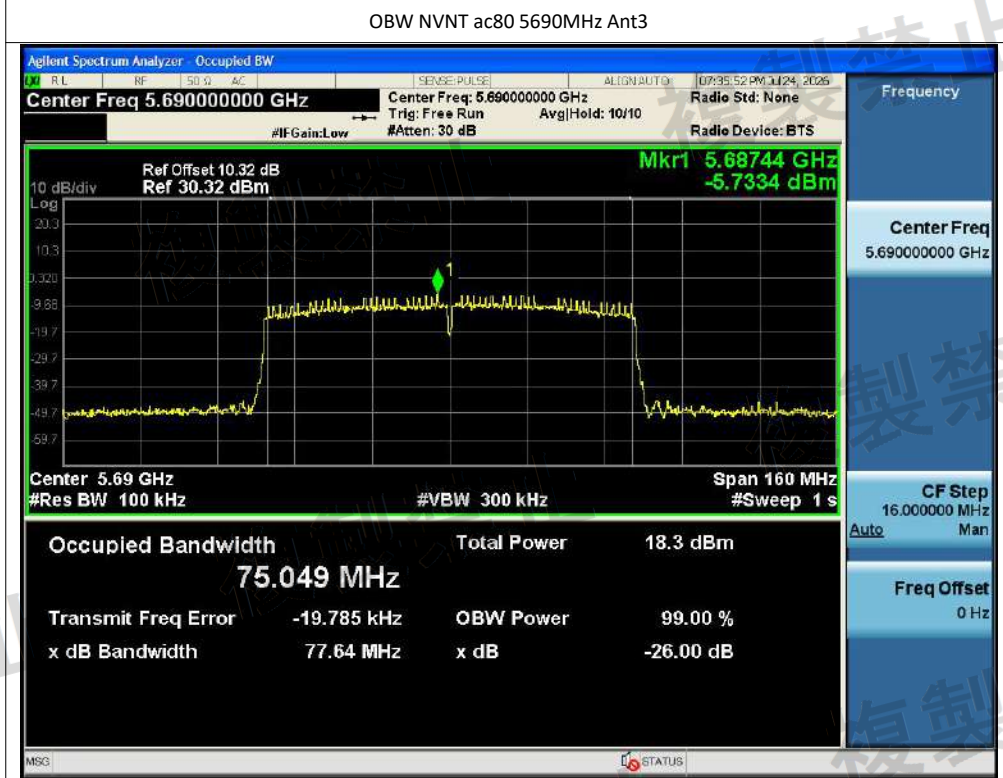

















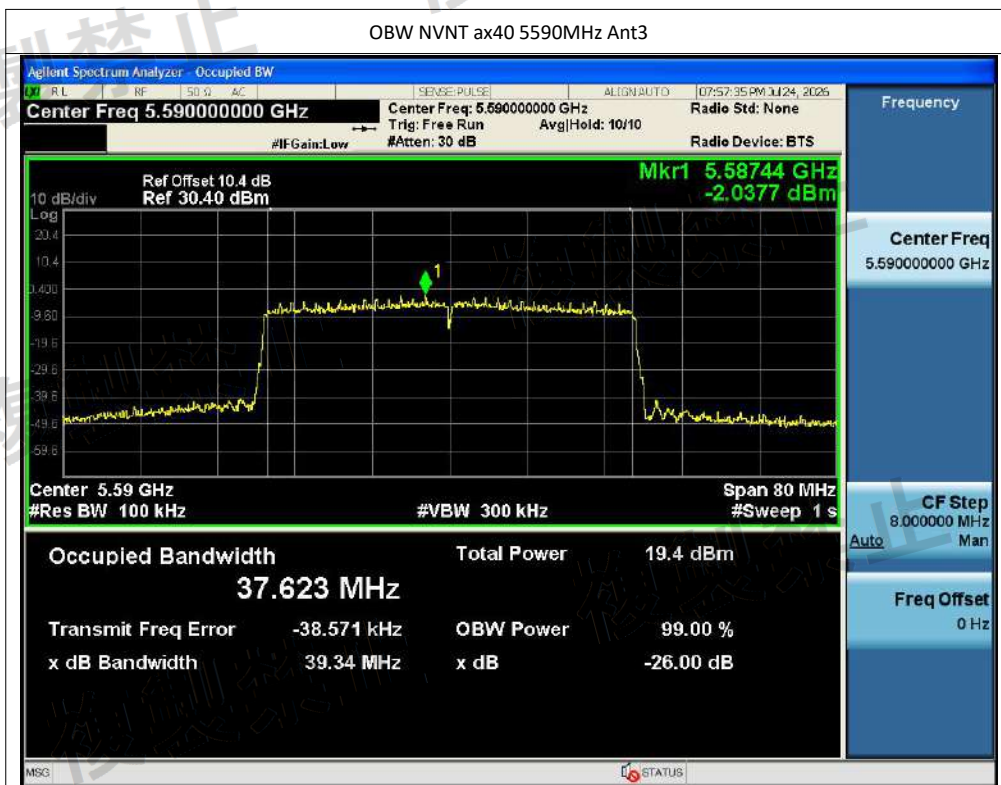


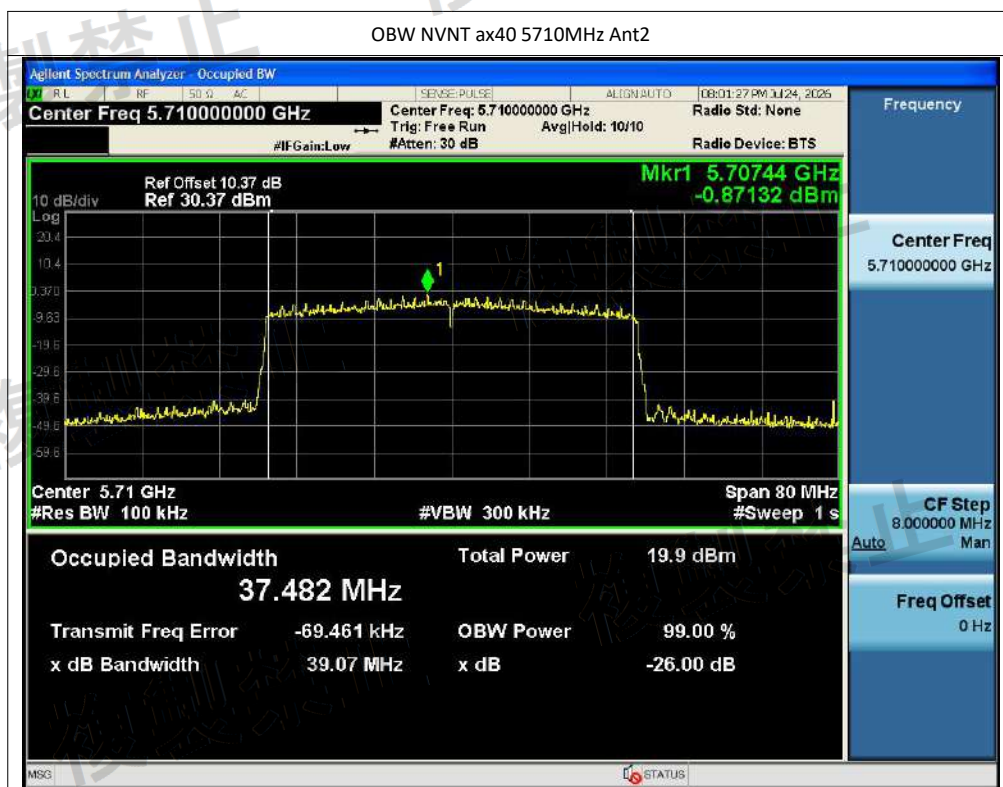









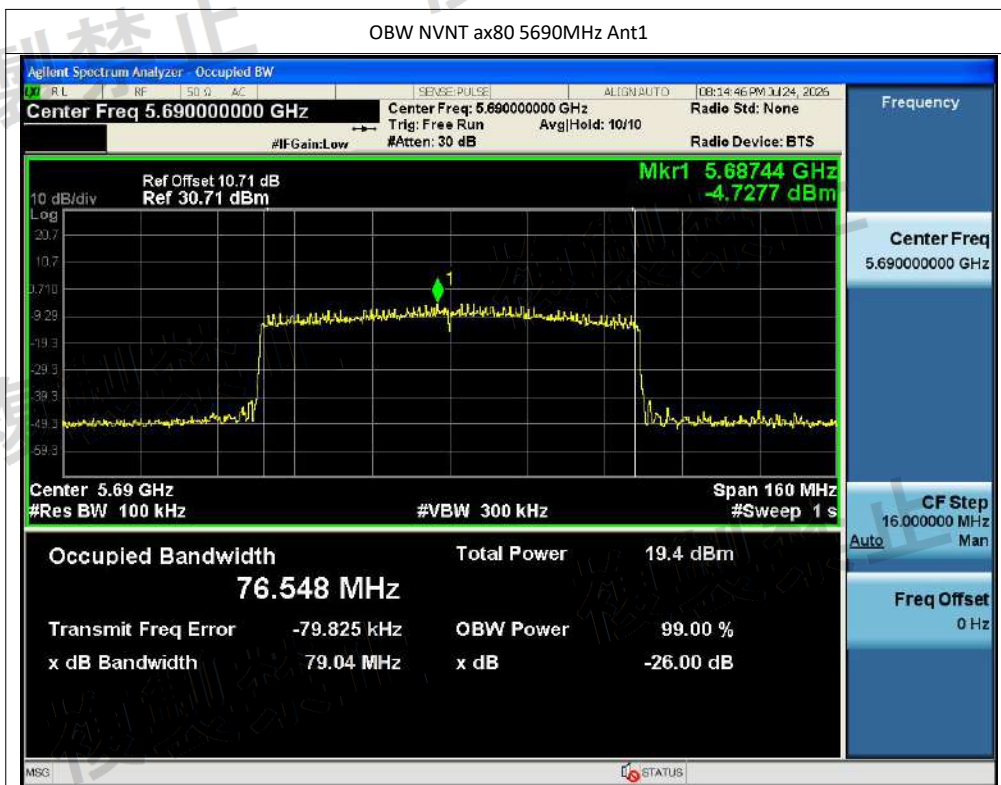


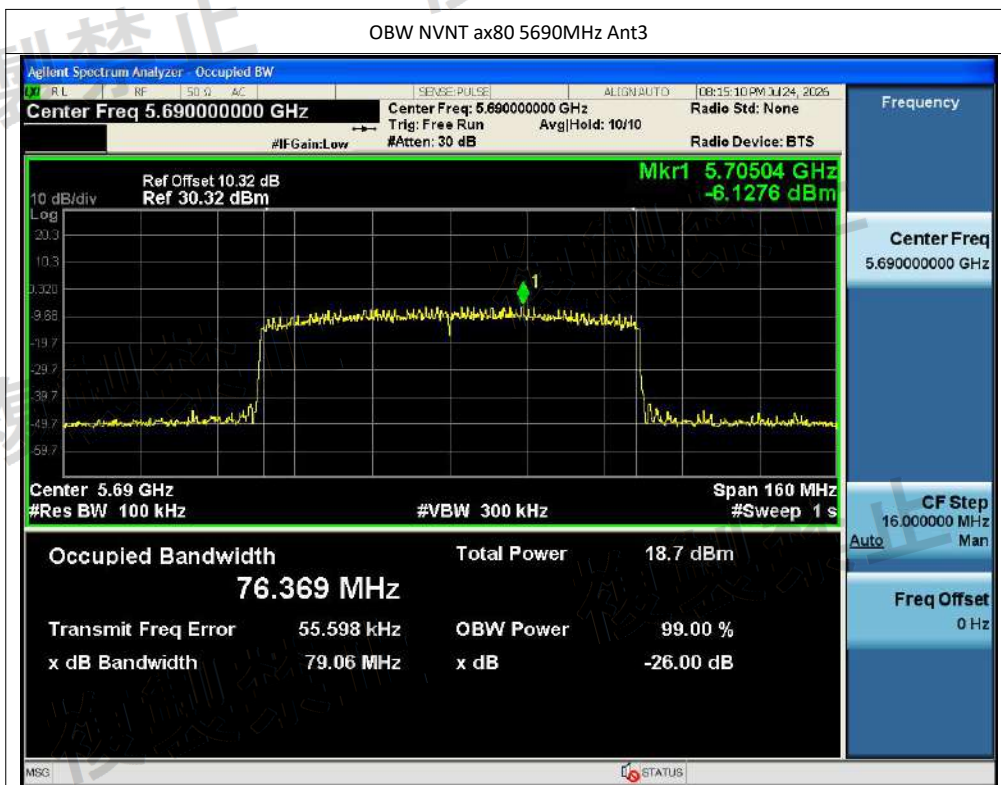





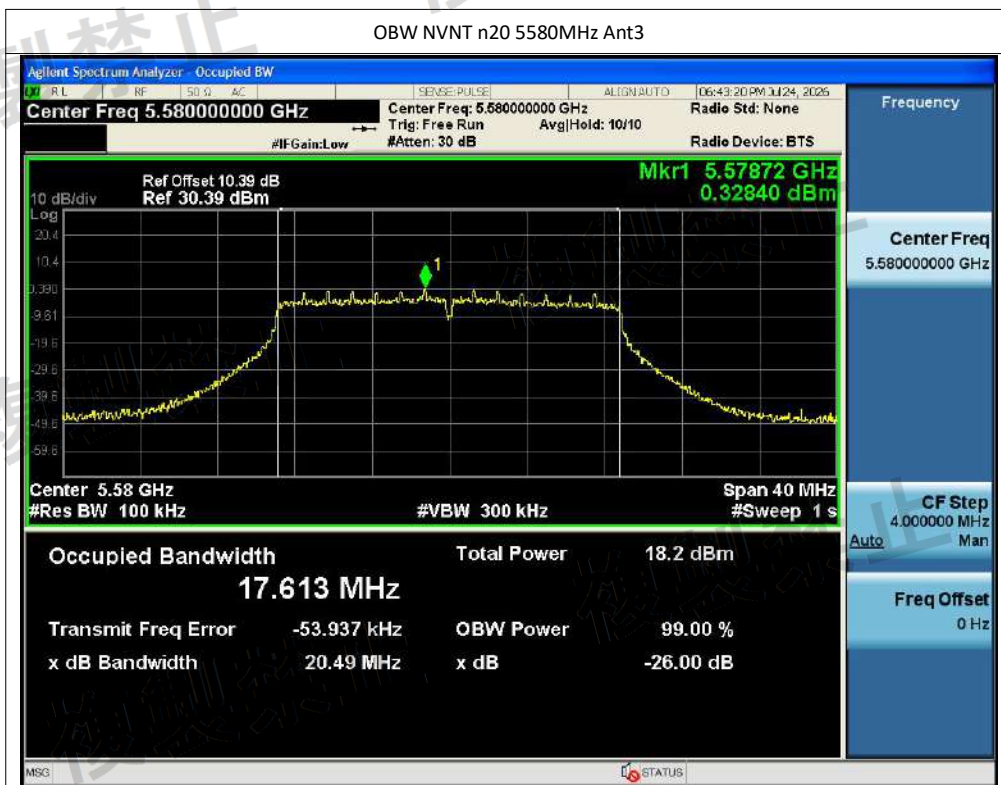


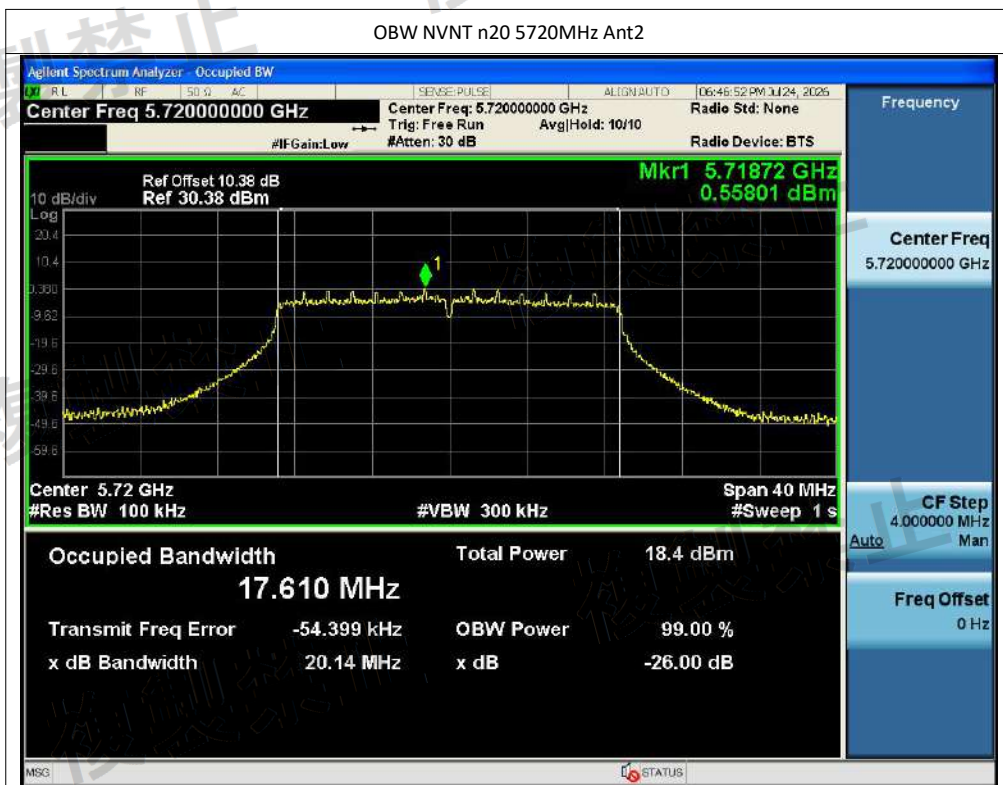








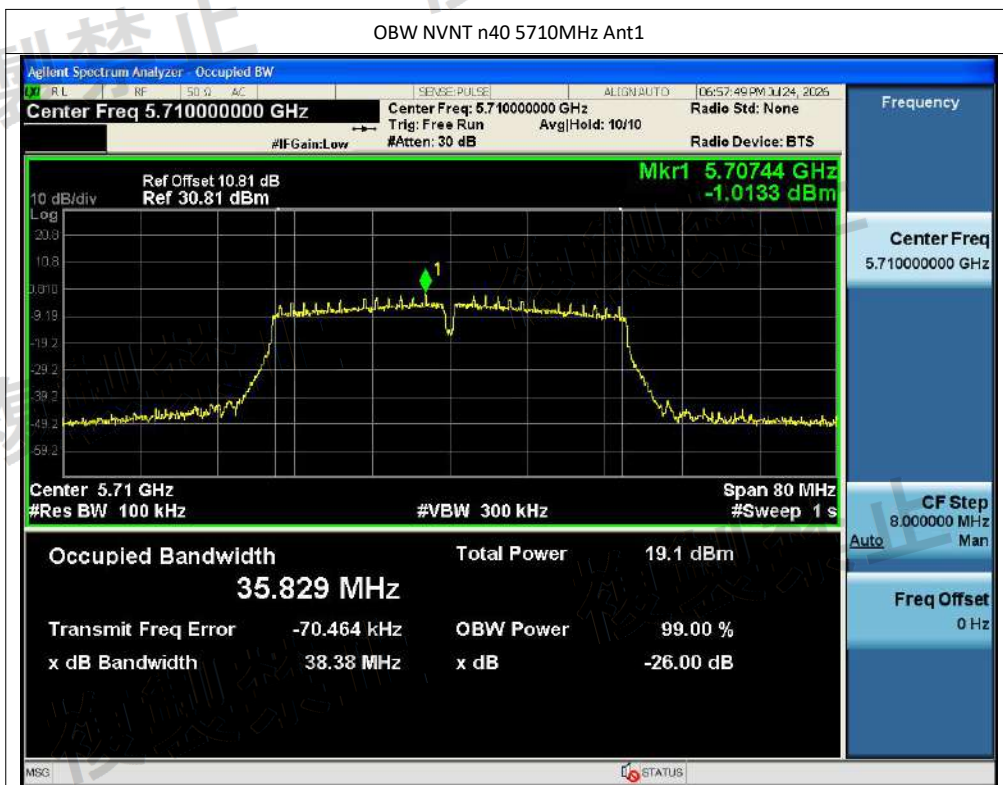

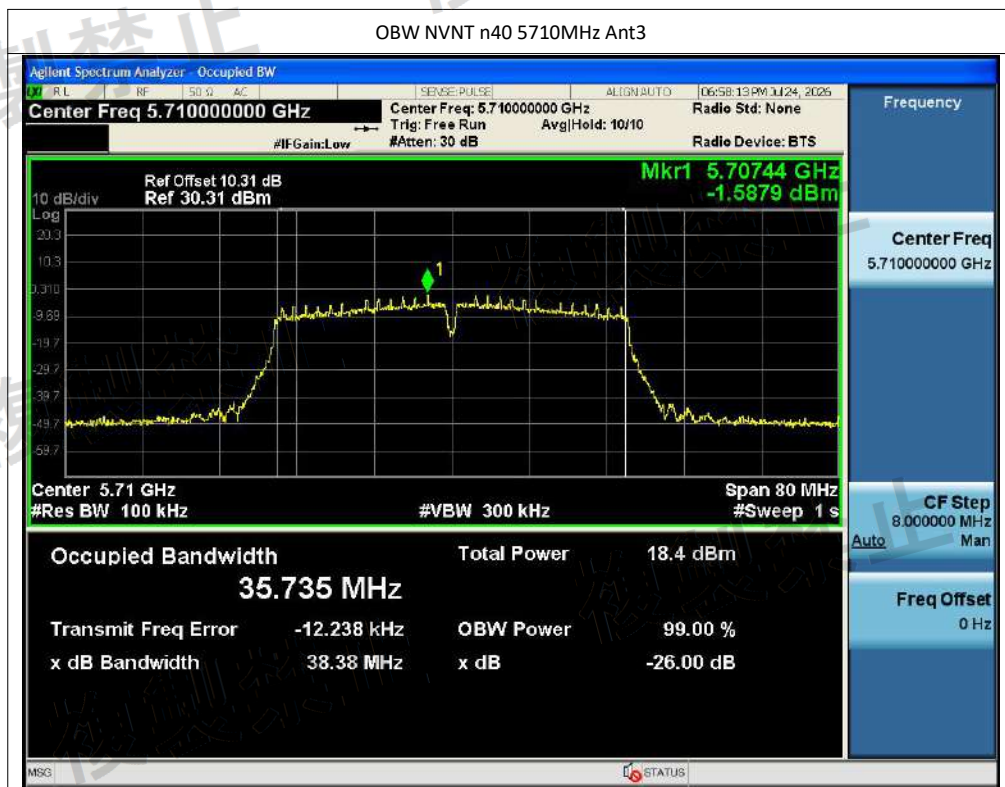

Spreading Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	90% OBW (MHz)
NVNT	a	5500	Ant1	14.548
NVNT	a	5580	Ant1	14.617
NVNT	a	5720	Ant1	14.574
NVNT	a	5500	Ant2	14.544
NVNT	a	5580	Ant2	14.621
NVNT	a	5720	Ant2	14.577
NVNT	a	5500	Ant3	14.58
NVNT	a	5580	Ant3	14.586
NVNT	a	5720	Ant3	14.561
NVNT	ac20	5500	Ant1	15.635
NVNT	ac20	5500	Ant2	15.762
NVNT	ac20	5500	Ant3	15.621
NVNT	ac20	5580	Ant1	15.73
NVNT	ac20	5580	Ant2	15.551
NVNT	ac20	5580	Ant3	15.584
NVNT	ac20	5720	Ant1	15.633
NVNT	ac20	5720	Ant2	15.537
NVNT	ac20	5720	Ant3	15.632
NVNT	ac40	5510	Ant1	30.598
NVNT	ac40	5510	Ant2	31.021
NVNT	ac40	5510	Ant3	30.973
NVNT	ac40	5590	Ant1	31.245
NVNT	ac40	5590	Ant2	31.34
NVNT	ac40	5590	Ant3	31.664
NVNT	ac40	5710	Ant1	30.537
NVNT	ac40	5710	Ant2	30.691
NVNT	ac40	5710	Ant3	29.967
NVNT	ac80	5530	Ant1	65.713
NVNT	ac80	5530	Ant2	66.205
NVNT	ac80	5530	Ant3	65.819
NVNT	ac80	5610	Ant1	64.625
NVNT	ac80	5610	Ant2	65.121
NVNT	ac80	5610	Ant3	64.046
NVNT	ac80	5690	Ant1	63.933
NVNT	ac80	5690	Ant2	64.558
NVNT	ac80	5690	Ant3	64.1
NVNT	ax20	5500	Ant1	16.641
NVNT	ax20	5500	Ant2	16.856
NVNT	ax20	5500	Ant3	16.763

NVNT	ax20	5580	Ant1	16.875
NVNT	ax20	5580	Ant2	16.689
NVNT	ax20	5580	Ant3	16.655
NVNT	ax20	5720	Ant1	16.681
NVNT	ax20	5720	Ant2	16.697
NVNT	ax20	5720	Ant3	16.521
NVNT	ax40	5510	Ant1	31.646
NVNT	ax40	5510	Ant2	32.19
NVNT	ax40	5510	Ant3	32.278
NVNT	ax40	5590	Ant1	33.092
NVNT	ax40	5590	Ant2	32.86
NVNT	ax40	5590	Ant3	33.422
NVNT	ax40	5710	Ant1	31.825
NVNT	ax40	5710	Ant2	31.723
NVNT	ax40	5710	Ant3	31.217
NVNT	ax80	5530	Ant1	66.671
NVNT	ax80	5530	Ant2	66.746
NVNT	ax80	5530	Ant3	66.05
NVNT	ax80	5610	Ant1	65.538
NVNT	ax80	5610	Ant2	66.166
NVNT	ax80	5610	Ant3	64.347
NVNT	ax80	5690	Ant1	64.875
NVNT	ax80	5690	Ant2	64.602
NVNT	ax80	5690	Ant3	64.847
NVNT	n20	5500	Ant1	15.59
NVNT	n20	5500	Ant2	15.646
NVNT	n20	5500	Ant3	15.735
NVNT	n20	5580	Ant1	15.764
NVNT	n20	5580	Ant2	15.564
NVNT	n20	5580	Ant3	15.652
NVNT	n20	5720	Ant1	15.703
NVNT	n20	5720	Ant2	15.623
NVNT	n20	5720	Ant3	15.549
NVNT	n40	5510	Ant1	30.733
NVNT	n40	5510	Ant2	31.184
NVNT	n40	5510	Ant3	30.487
NVNT	n40	5590	Ant1	31.381
NVNT	n40	5590	Ant2	31.622
NVNT	n40	5590	Ant3	31.803
NVNT	n40	5710	Ant1	30.458
NVNT	n40	5710	Ant2	30.654
NVNT	n40	5710	Ant3	30.128

Test Graphs

Spreading Bandwidth NVNT a 5500MHz Ant1



Spreading Bandwidth NVNT a 5580MHz Ant1





Spreading Bandwidth NVNT a 5720MHz Ant1



Spreading Bandwidth NVNT a 5500MHz Ant2



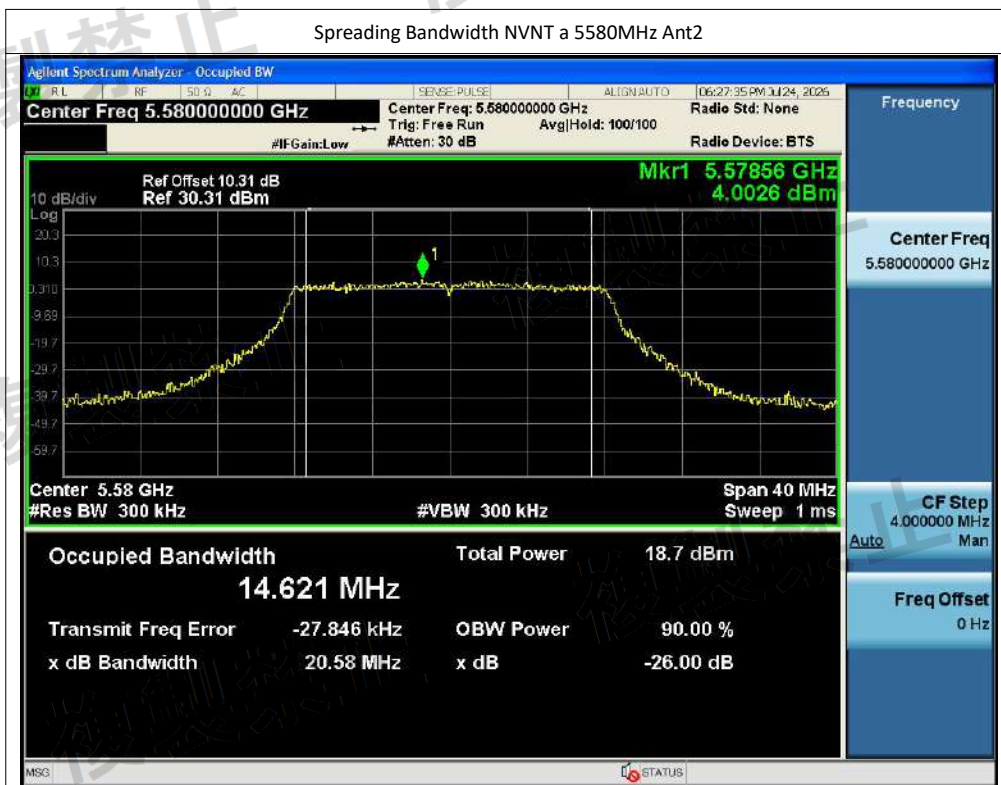

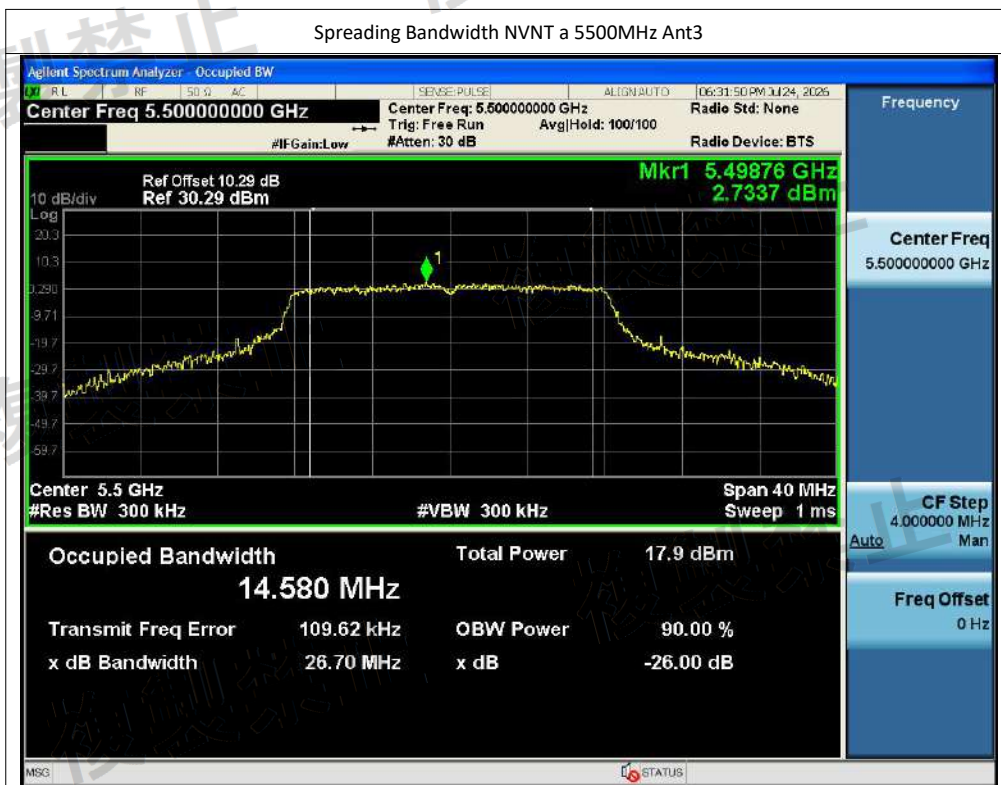




Spreading Bandwidth NVNT a 5720MHz Ant3





Spreading Bandwidth NVNT ac20 5500MHz Ant1



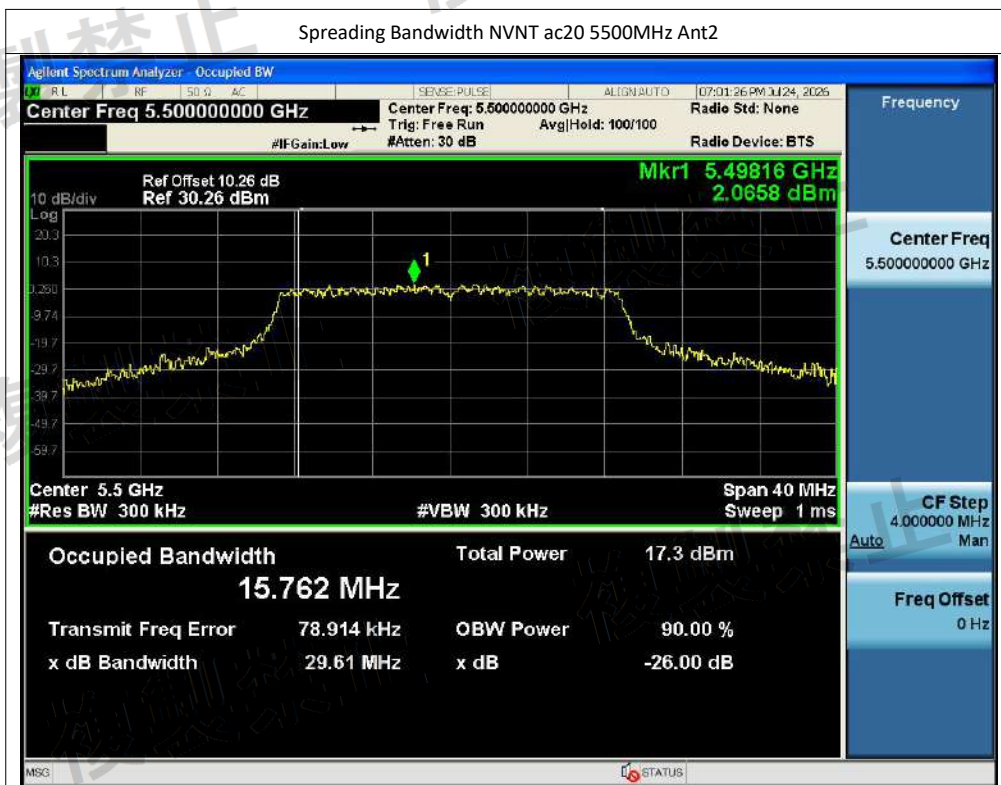

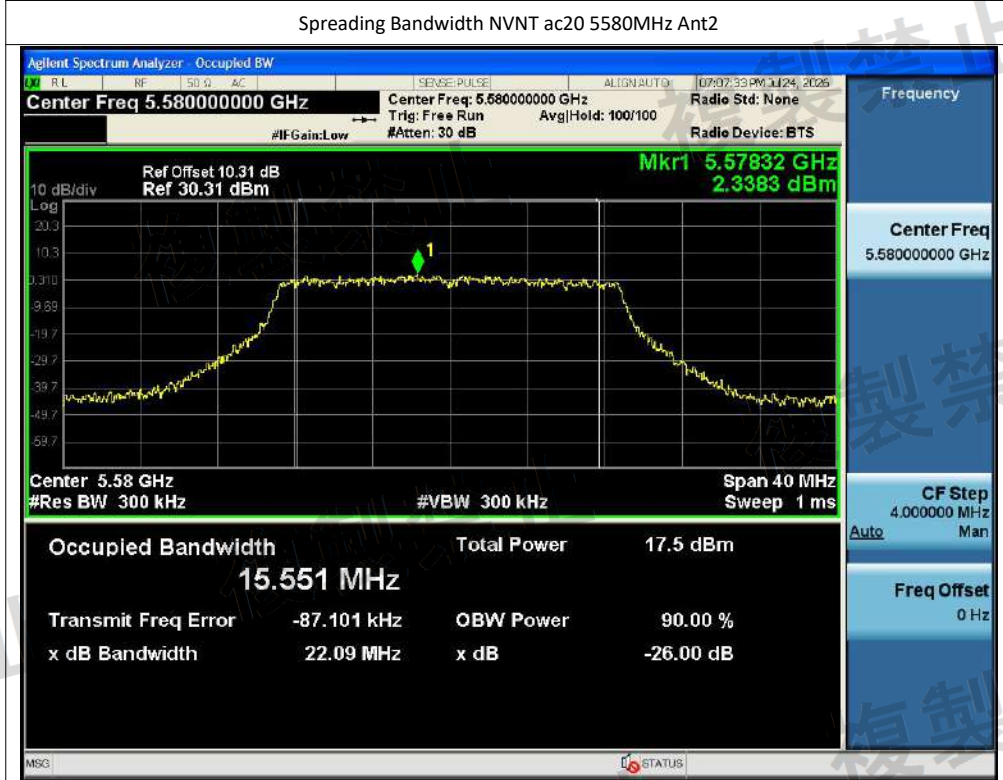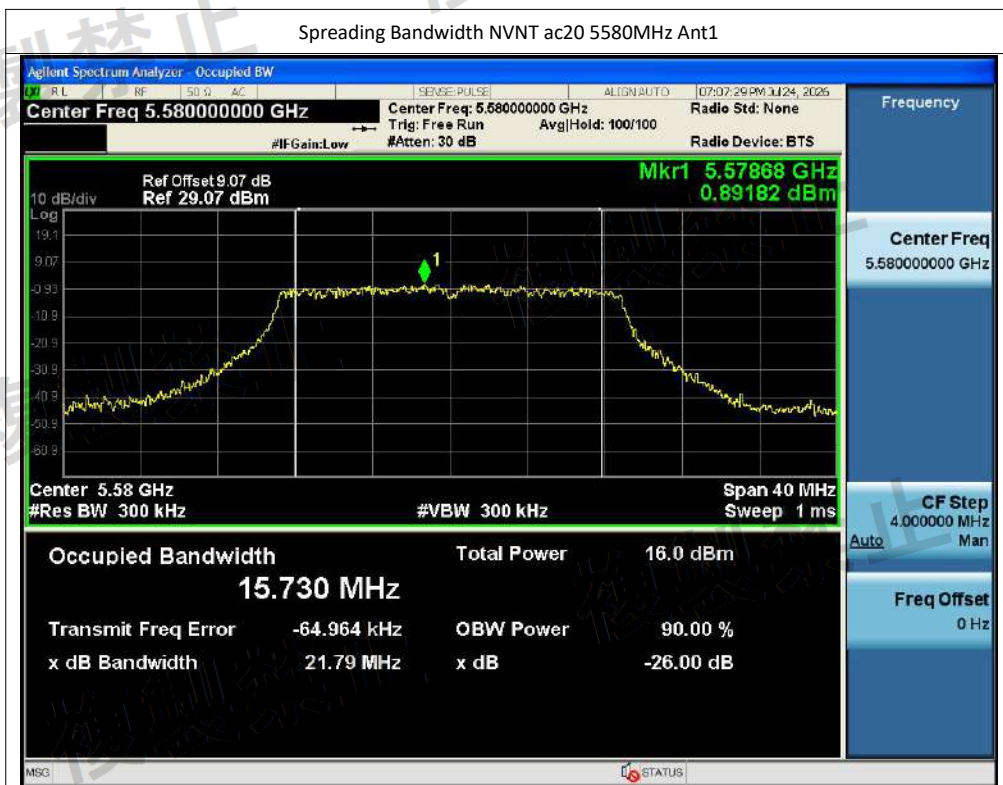

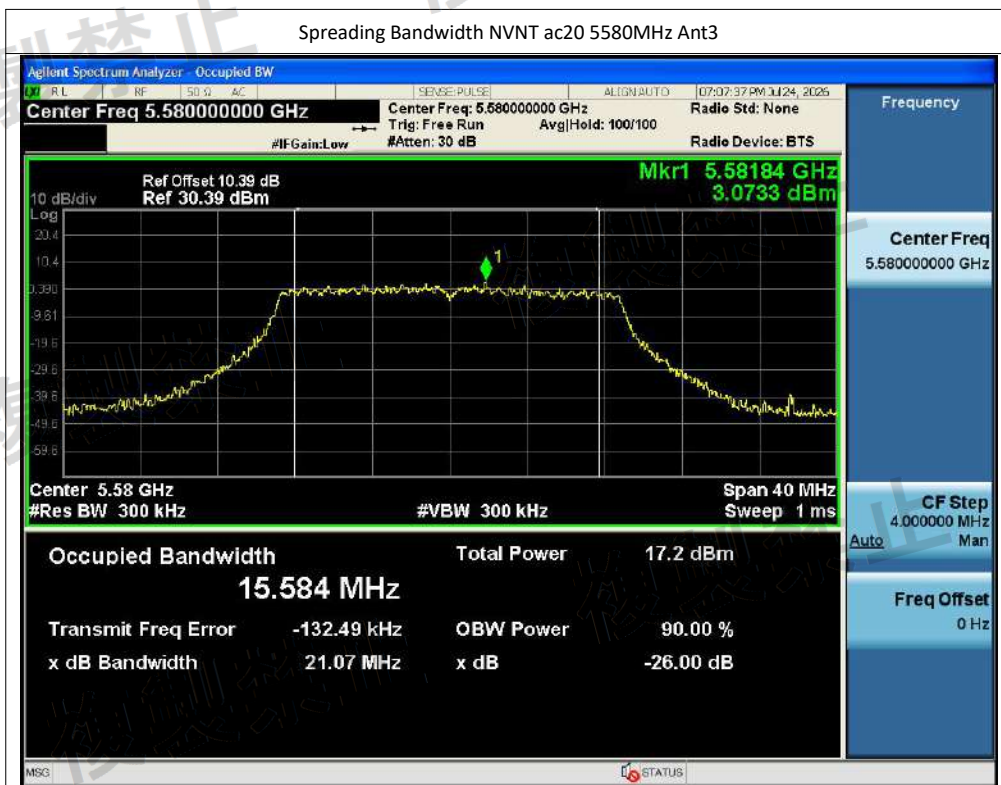

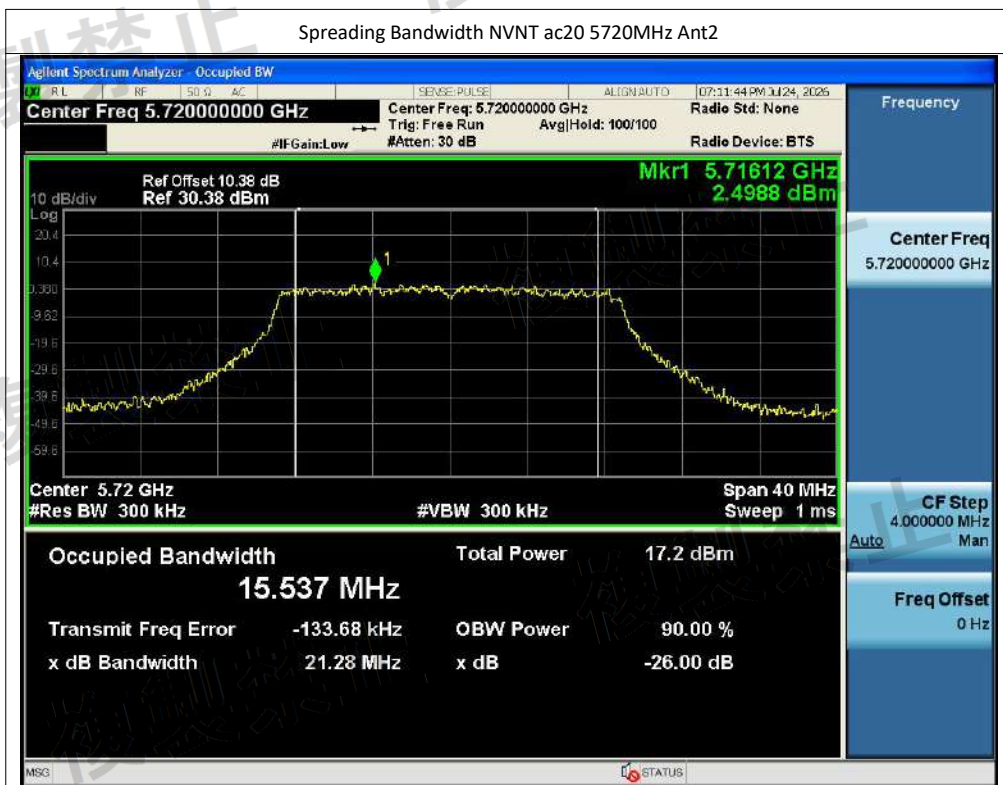



Spreading Bandwidth NVNT ac40 5510MHz Ant3



Spreading Bandwidth NVNT ac40 5590MHz Ant1




Spreading Bandwidth NVNT ac40 5590MHz Ant2



Spreading Bandwidth NVNT ac40 5590MHz Ant3




Spreading Bandwidth NVNT ac40 5710MHz Ant1

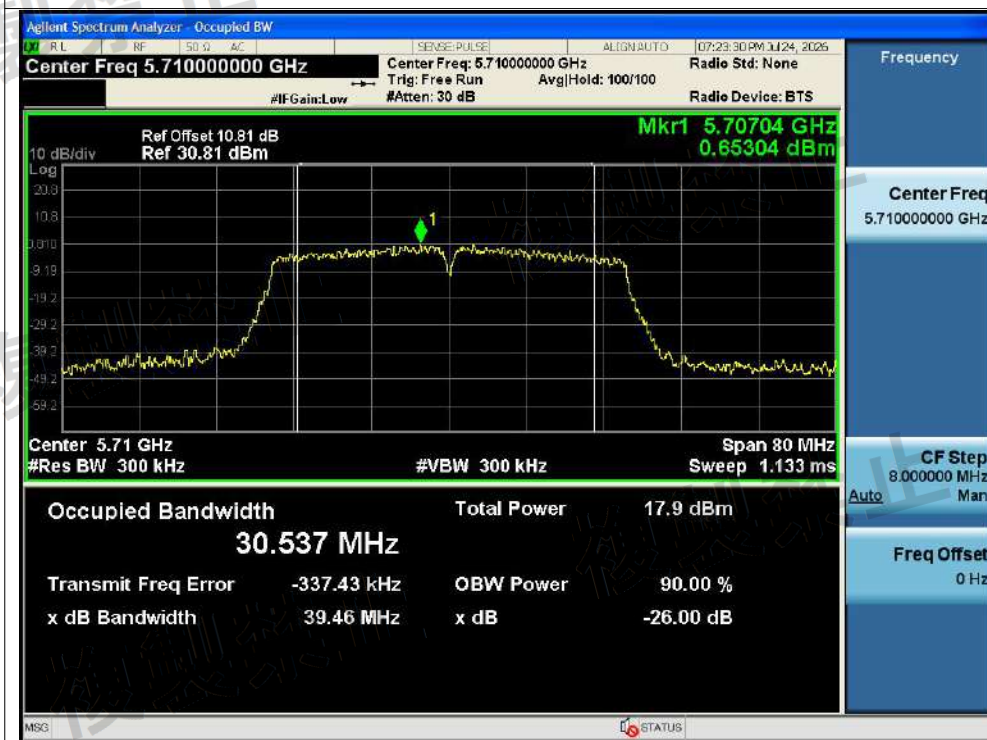

Spreading Bandwidth NVNT ac40 5710MHz Ant2



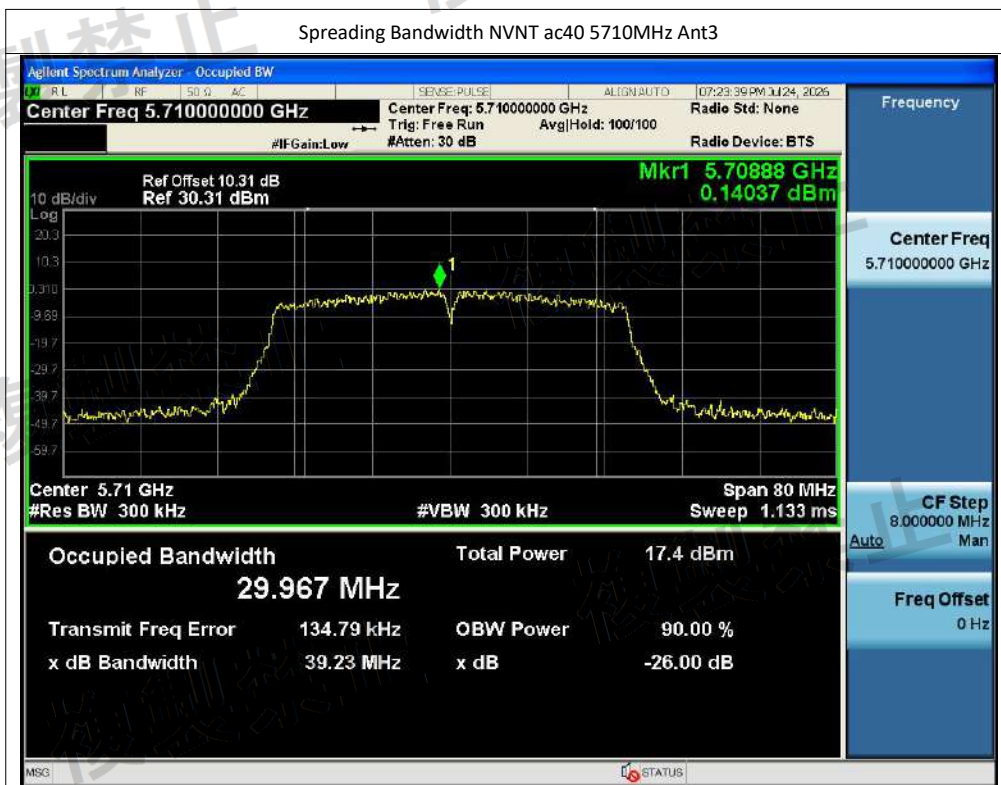

Spreading Bandwidth NVNT ac80 5530MHz Ant2



Spreading Bandwidth NVNT ac80 5530MHz Ant3



Spreading Bandwidth NVNT ac80 5610MHz Ant1



Spreading Bandwidth NVNT ac80 5610MHz Ant2



Spreading Bandwidth NVNT ac80 5610MHz Ant3




Spreading Bandwidth NVNT ac80 5690MHz Ant1



Spreading Bandwidth NVNT ac80 5690MHz Ant2



Spreading Bandwidth NVNT ac80 5690MHz Ant3

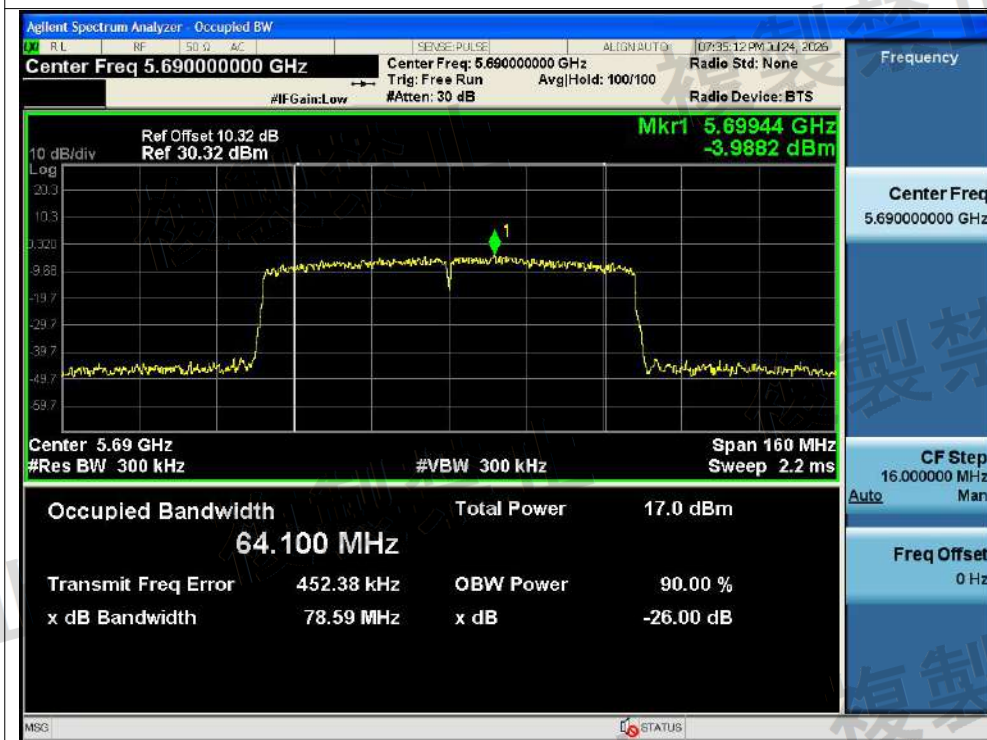

Spreading Bandwidth NVNT ax20 5500MHz Ant1



Spreading Bandwidth NVNT ax20 5500MHz Ant2




Spreading Bandwidth NVNT ax20 5500MHz Ant3



Spreading Bandwidth NVNT ax20 5580MHz Ant1



Spreading Bandwidth NVNT ax20 5580MHz Ant2

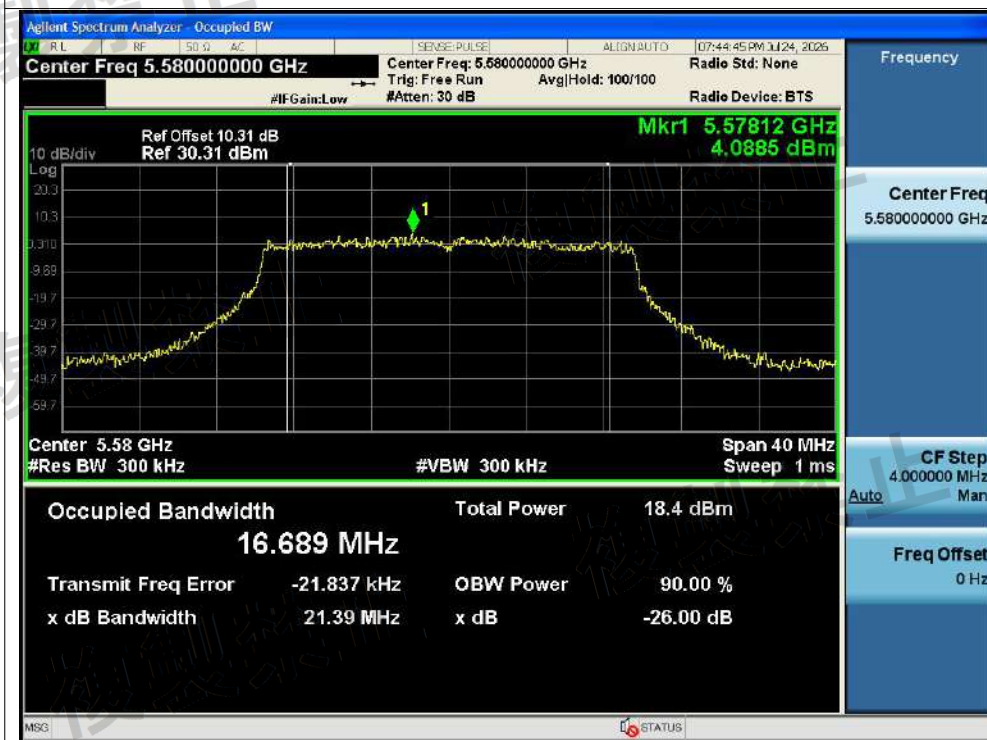

Spreading Bandwidth NVNT ax20 5580MHz Ant3



Spreading Bandwidth NVNT ax20 5720MHz Ant1



Spreading Bandwidth NVNT ax20 5720MHz Ant2



Spreading Bandwidth NVNT ax20 5720MHz Ant3



Spreading Bandwidth NVNT ax40 5510MHz Ant1



Spreading Bandwidth NVNT ax40 5510MHz Ant2



Spreading Bandwidth NVNT ax40 5510MHz Ant3





Spreading Bandwidth NVNT ax40 5590MHz Ant1




Spreading Bandwidth NVNT ax40 5590MHz Ant2




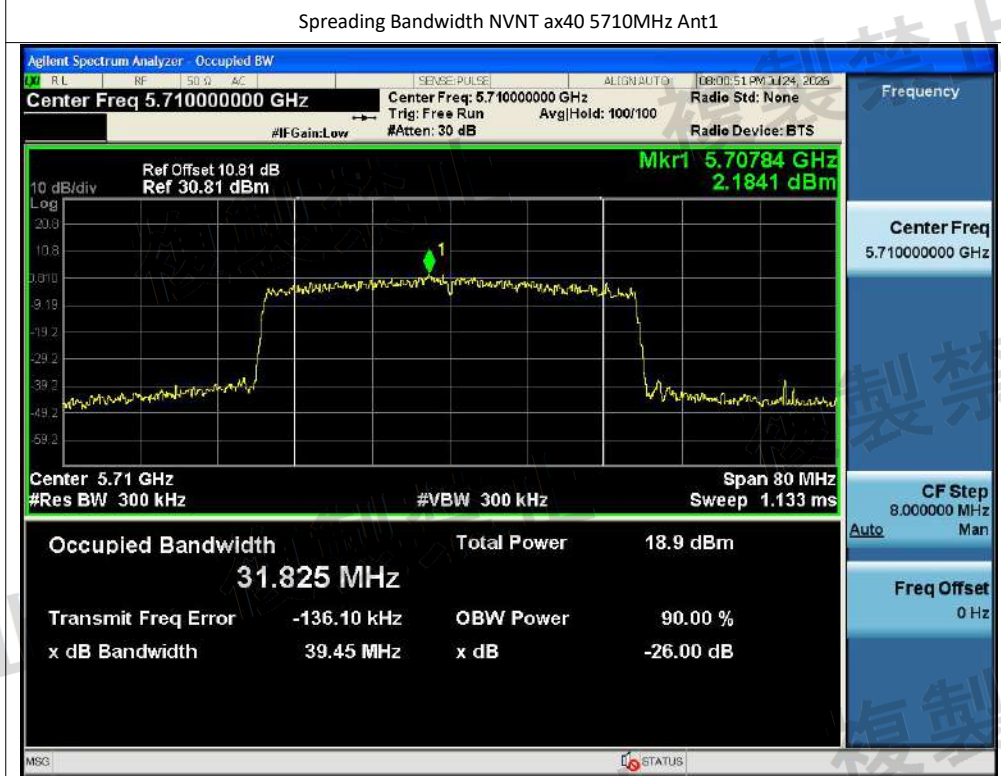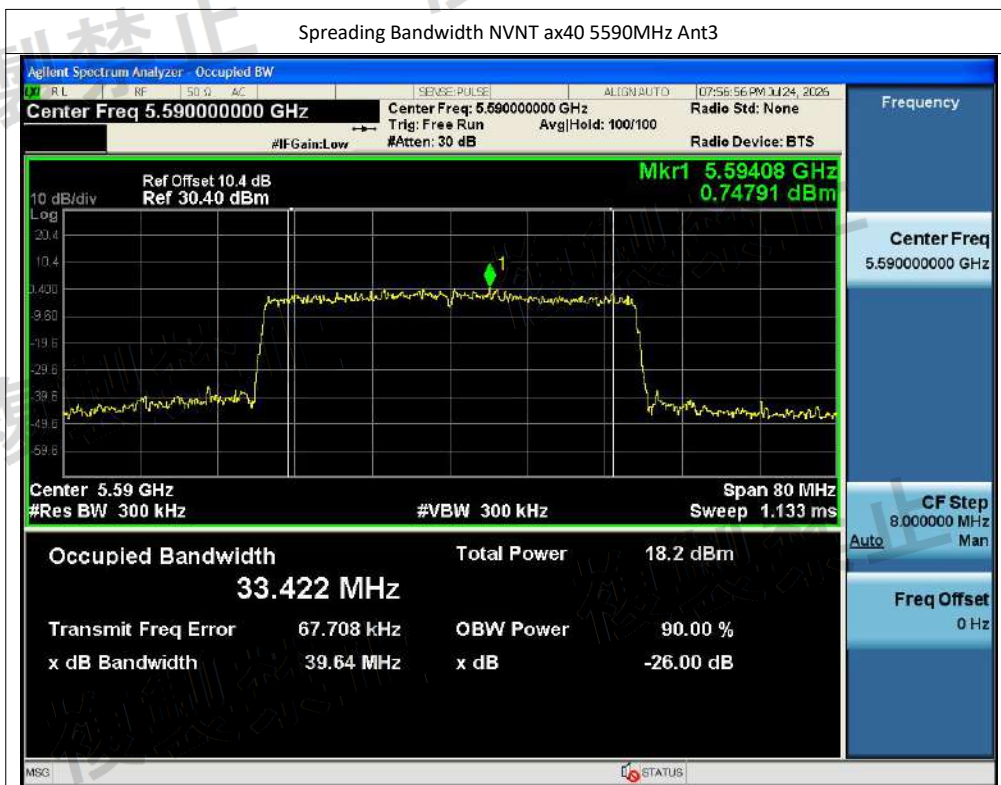

Spreading Bandwidth NVNT ax40 5710MHz Ant2

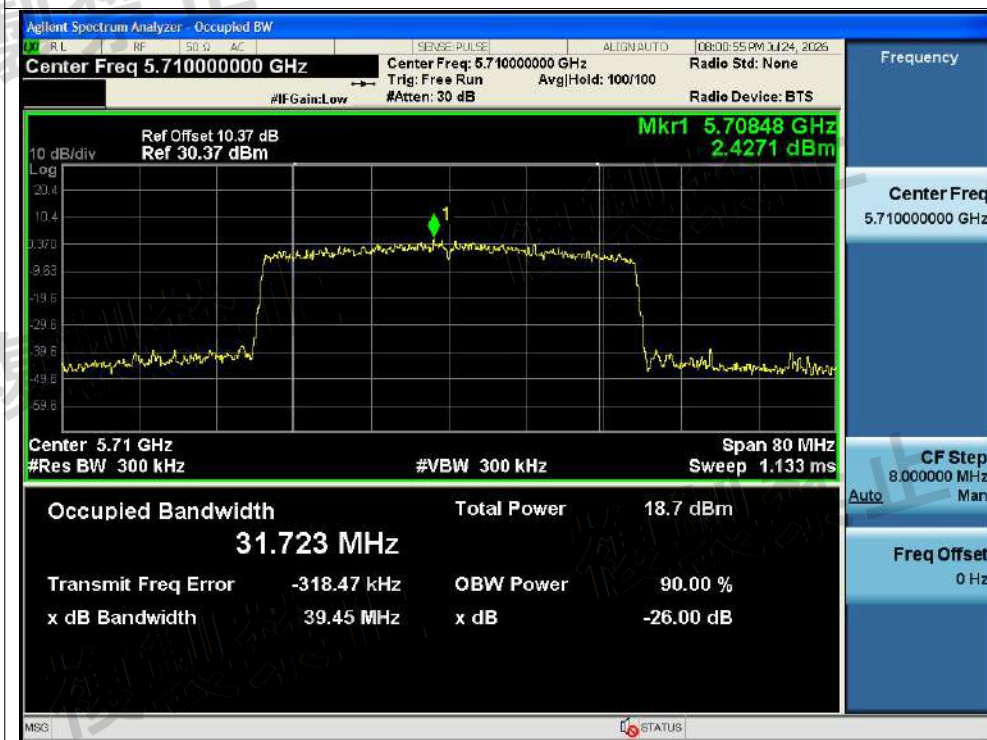

Spreading Bandwidth NVNT ax40 5710MHz Ant3

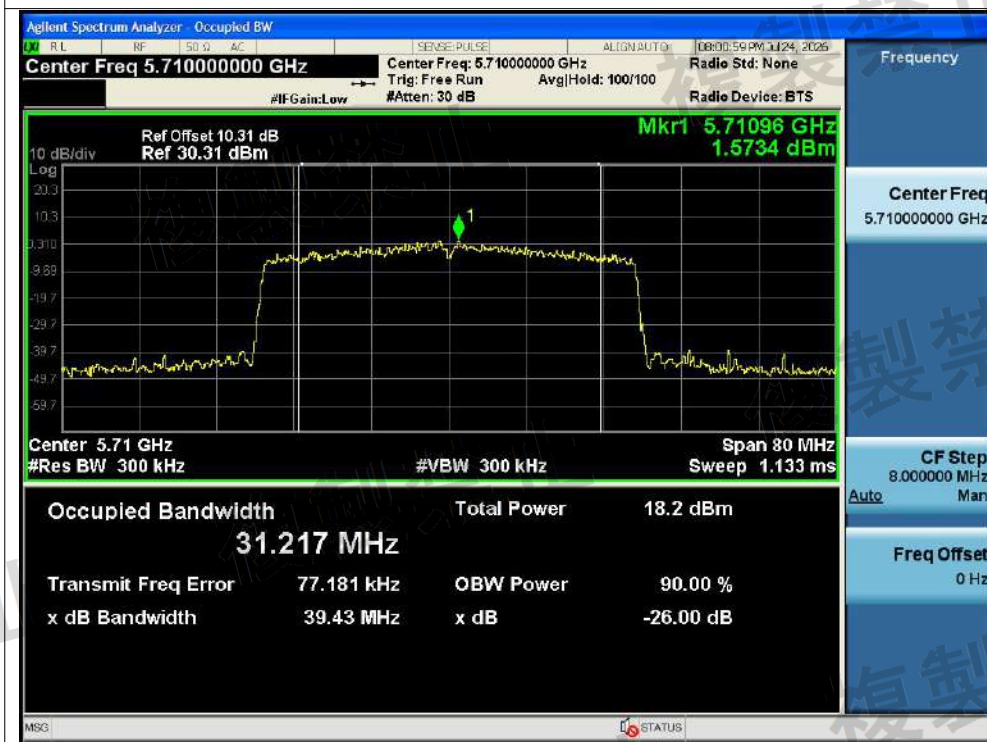

Spreading Bandwidth NVNT ax80 5530MHz Ant1



Spreading Bandwidth NVNT ax80 5530MHz Ant2




Spreading Bandwidth NVNT ax80 5530MHz Ant3



Spreading Bandwidth NVNT ax80 5610MHz Ant1



Spreading Bandwidth NVNT ax80 5610MHz Ant2

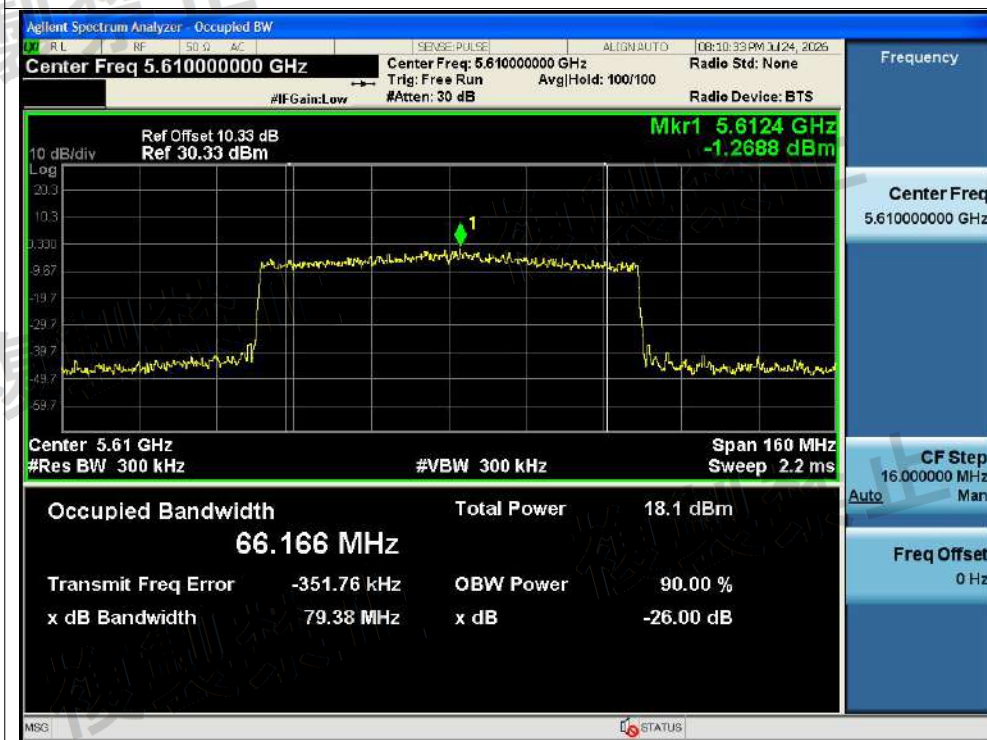

Spreading Bandwidth NVNT ax80 5610MHz Ant3




Spreading Bandwidth NVNT ax80 5690MHz Ant1



Spreading Bandwidth NVNT ax80 5690MHz Ant2







Spreading Bandwidth NVNT ax80 5690MHz Ant3


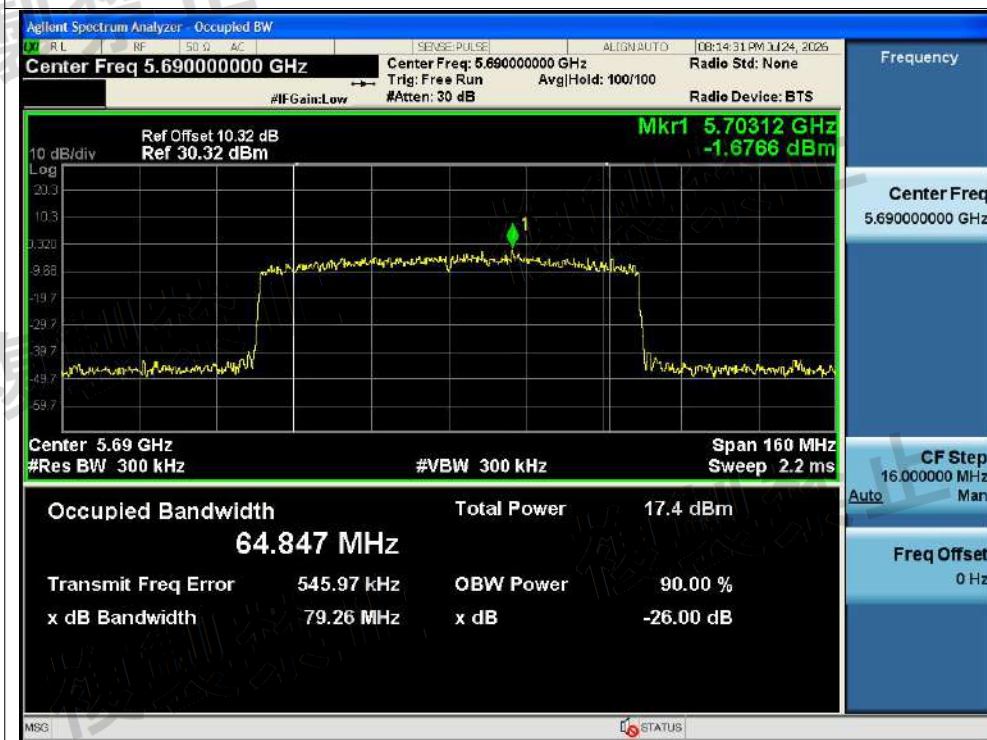




Spreading Bandwidth NVNT n20 5500MHz Ant1



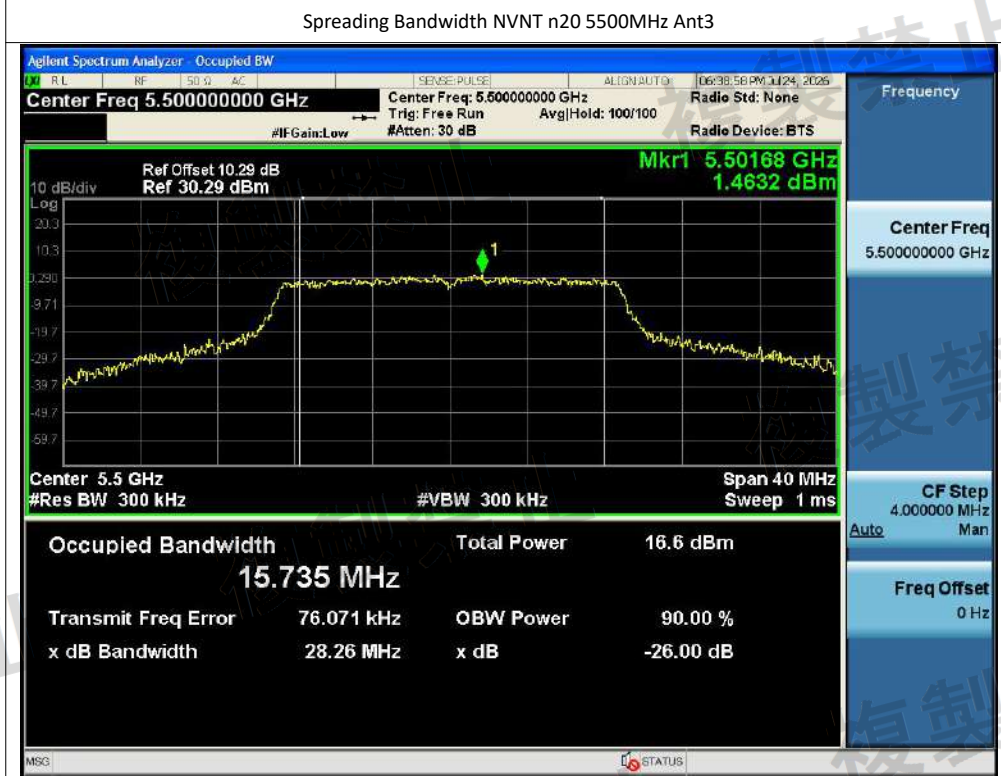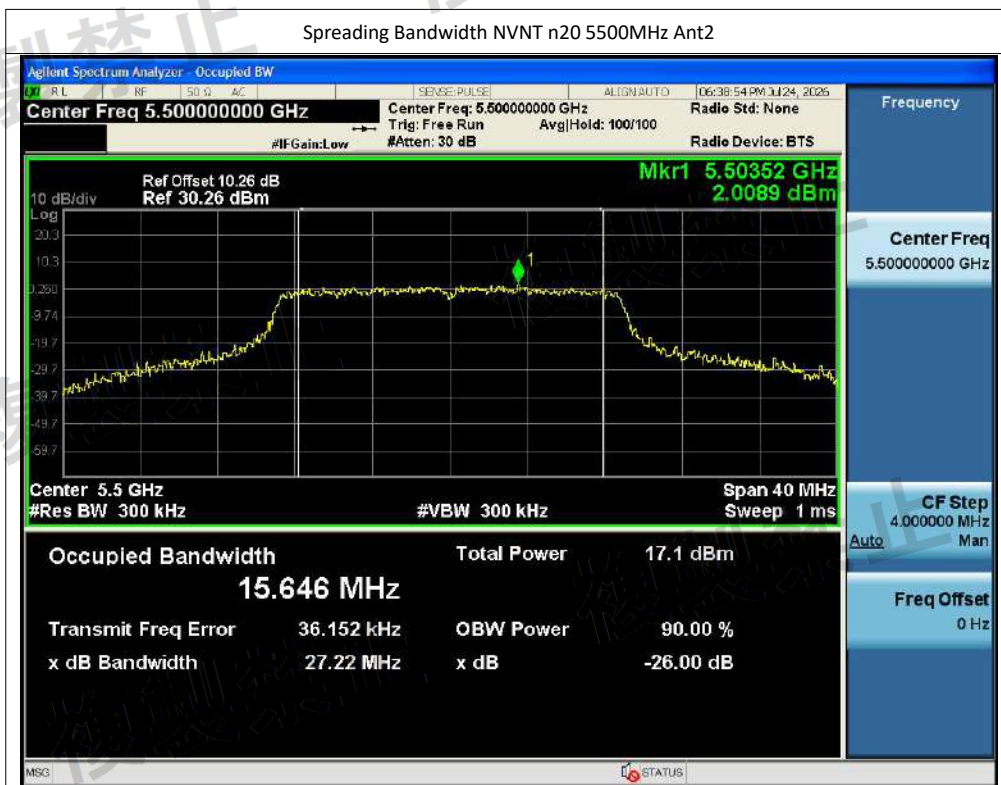

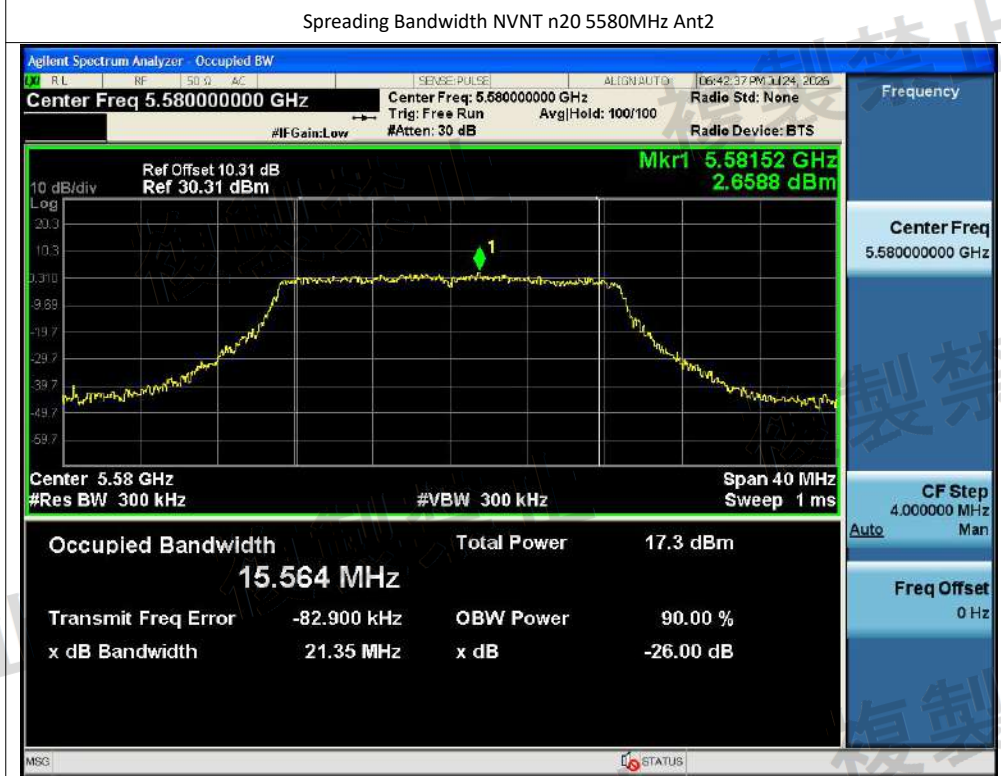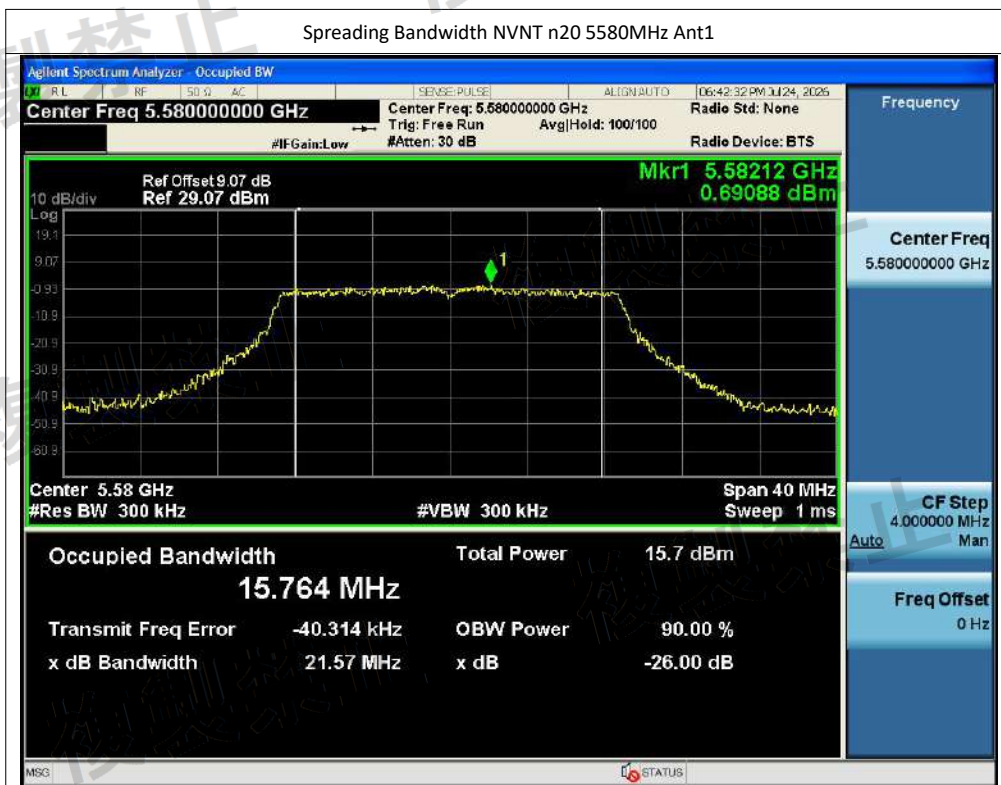


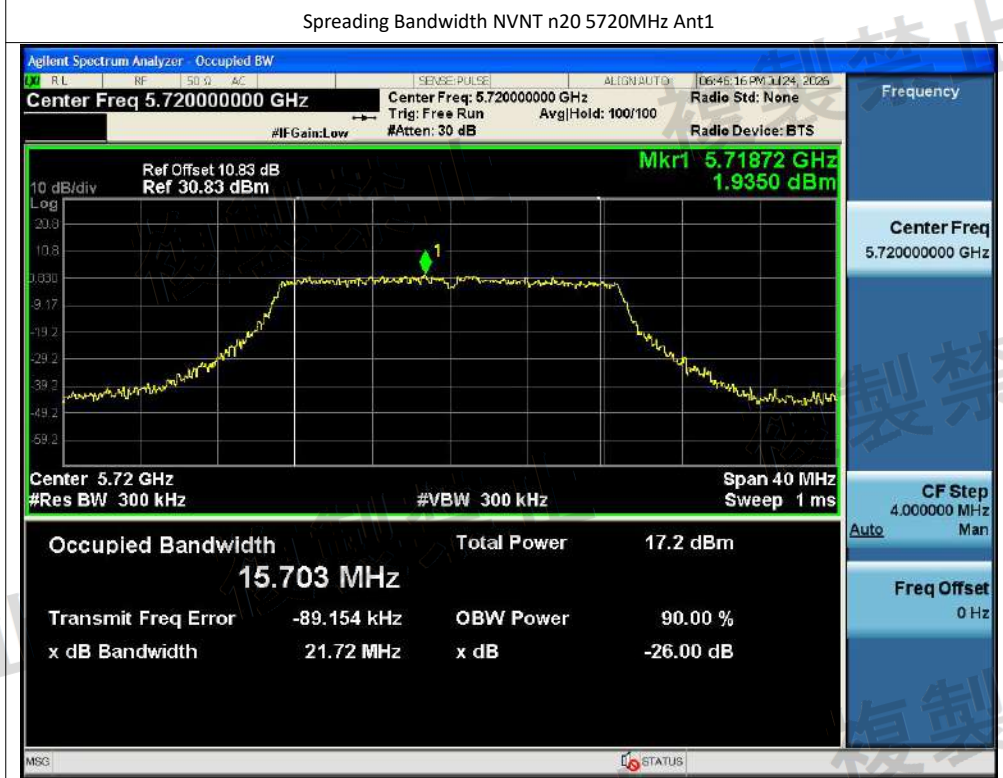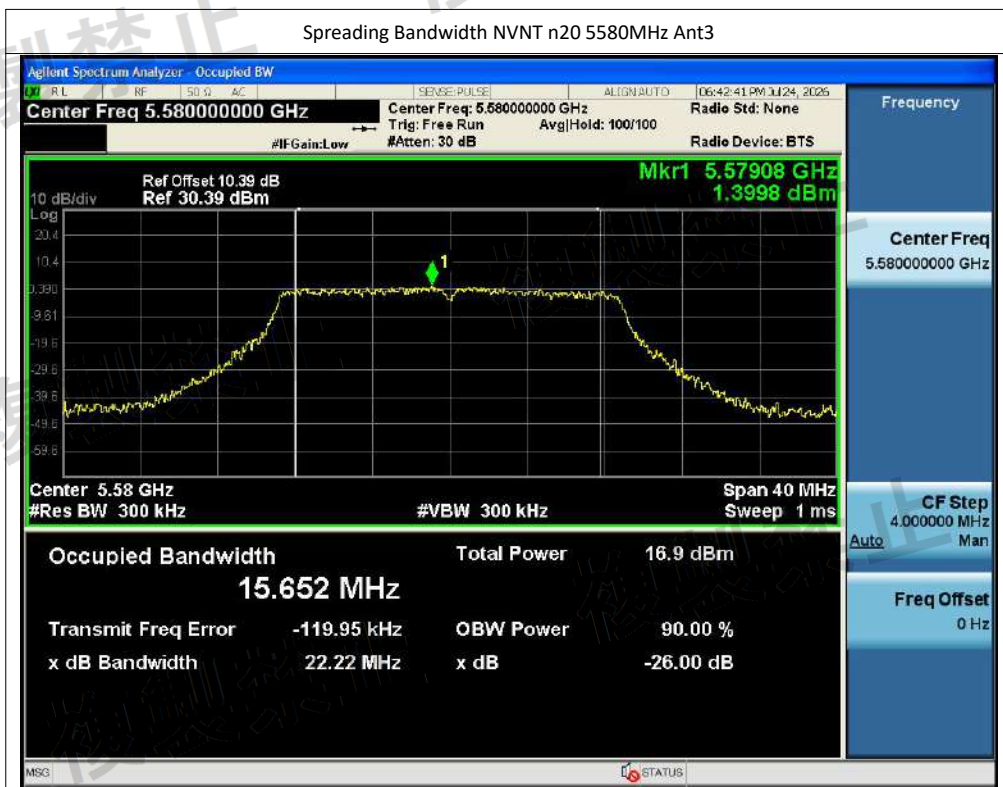


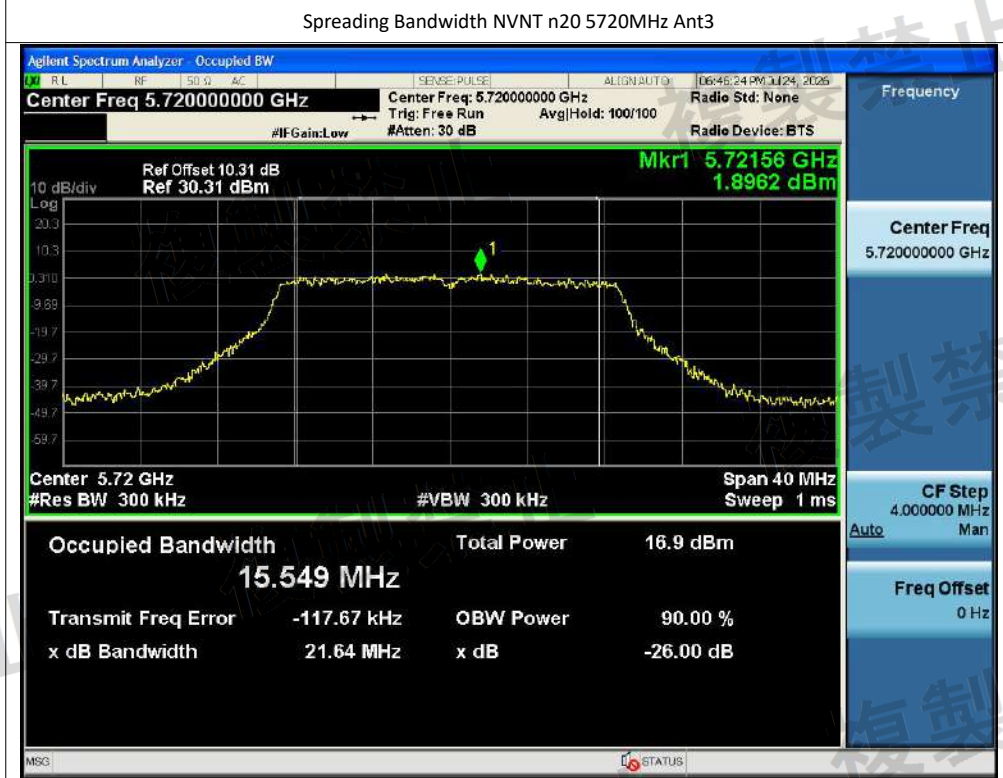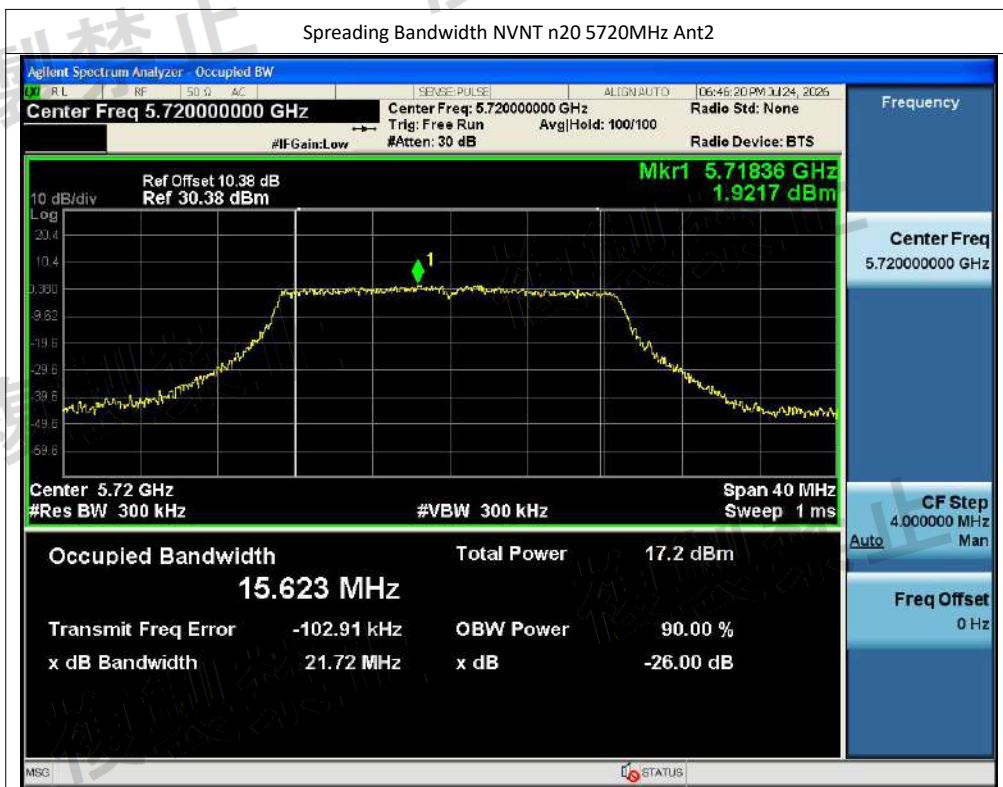





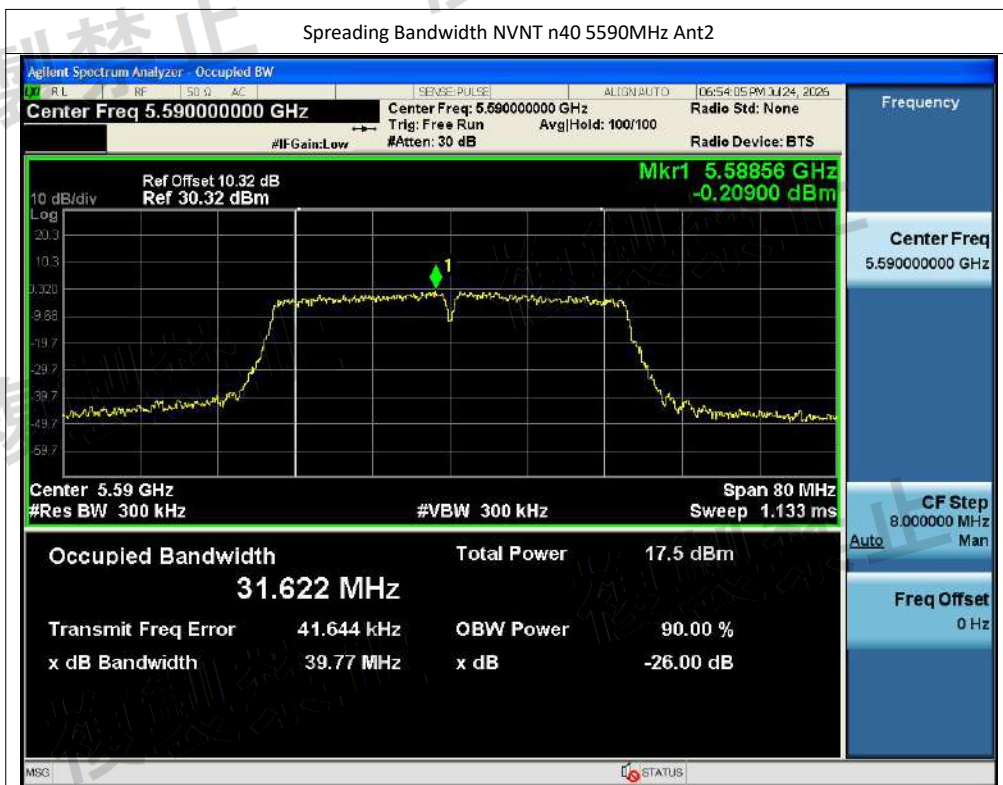

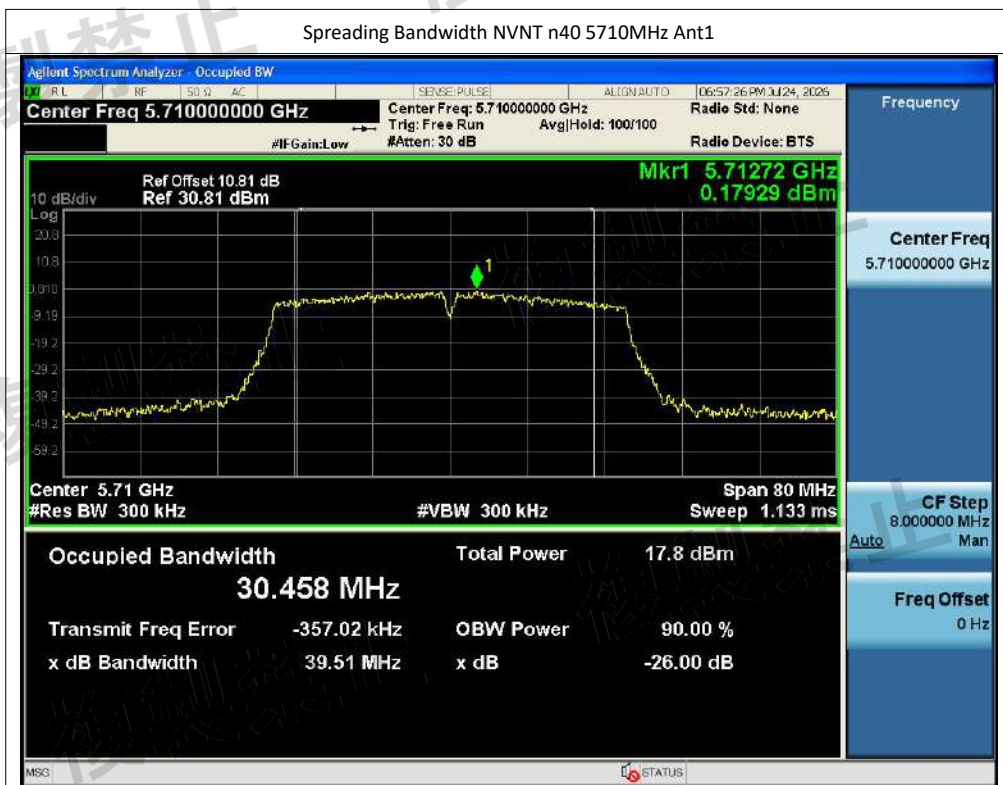



Tx Spurious Emission

Condition	Mode	Frequency (MHz)	Antenna	Range (MHz)	Emission Frequency (MHz)	Max Peak Value (dBm)	Max RMS Value (dBm)	Max Peak Value (uW)	Max RMS Value (uW)	Limit Start(uW)	Limit Stop (uW)	Verdict
NVNT	a	5500	Ant1	30-5460	5460.00	-46.50	NA	0.0224	NA	2.5	2.5	Pass
NVNT	a	5500	Ant1	5460-5470	5460.10	-45.29	NA	0.0296	NA	12.5	12.5	Pass
NVNT	a	5500	Ant1	5745-5765	5747.14	-49.21	NA	0.012	NA	12.5	12.5	Pass
NVNT	a	5500	Ant1	5765-26000	24704.96	-38.19	NA	0.1517	NA	2.5	2.5	Pass
NVNT	a	5580	Ant1	30-5460	2468.07	-42.88	NA	0.0515	NA	2.5	2.5	Pass
NVNT	a	5580	Ant1	5460-5470	5460.17	-47.62	NA	0.0173	NA	12.5	12.5	Pass
NVNT	a	5580	Ant1	5745-5765	5754.12	-48.85	NA	0.013	NA	12.5	12.5	Pass
NVNT	a	5580	Ant1	5765-26000	25372.72	-38.95	NA	0.1274	NA	2.5	2.5	Pass
NVNT	a	5720	Ant1	30-5460	2473.50	-42.93	NA	0.0509	NA	2.5	2.5	Pass
NVNT	a	5720	Ant1	5460-5470	5469.62	-47.60	NA	0.0174	NA	12.5	12.5	Pass
NVNT	a	5720	Ant1	5745-5765	5748.22	-33.03	NA	0.4977	NA	12.5	12.5	Pass
NVNT	a	5720	Ant1	5765-26000	24684.73	-37.12	NA	0.1941	NA	2.5	2.5	Pass
NVNT	a	5500	Ant2	30-5460	5454.57	-46.35	NA	0.0232	NA	2.5	2.5	Pass
NVNT	a	5500	Ant2	5460-5470	5460.10	-46.30	NA	0.0234	NA	12.5	12.5	Pass
NVNT	a	5500	Ant2	5745-5765	5762.50	-49.27	NA	0.0118	NA	12.5	12.5	Pass
NVNT	a	5500	Ant2	5765-26000	24704.96	-37.94	NA	0.1607	NA	2.5	2.5	Pass
NVNT	a	5580	Ant2	30-5460	2468.07	-46.02	NA	0.025	NA	2.5	2.5	Pass
NVNT	a	5580	Ant2	5460-5470	5460.00	-46.81	NA	0.0208	NA	12.5	12.5	Pass
NVNT	a	5580	Ant2	5745-5765	5747.12	-48.66	NA	0.0136	NA	12.5	12.5	Pass
NVNT	a	5580	Ant2	5765-26000	25129.90	-37.89	NA	0.1626	NA	2.5	2.5	Pass
NVNT	a	5720	Ant2	30-5460	2473.50	-45.12	NA	0.0308	NA	2.5	2.5	Pass
NVNT	a	5720	Ant2	5460-5470	5464.51	-49.28	NA	0.0118	NA	12.5	12.5	Pass
NVNT	a	5720	Ant2	5745-5765	5746.90	-32.73	NA	0.5333	NA	12.5	12.5	Pass
NVNT	a	5720	Ant2	5765-26000	24684.73	-36.88	NA	0.2051	NA	2.5	2.5	Pass
NVNT	a	5500	Ant3	30-5460	2473.50	-45.25	NA	0.0299	NA	2.5	2.5	Pass
NVNT	a	5500	Ant3	5460-5470	5469.49	-44.91	NA	0.0323	NA	12.5	12.5	Pass
NVNT	a	5500	Ant3	5745-5765	5758.08	-48.05	NA	0.0157	NA	12.5	12.5	Pass
NVNT	a	5500	Ant3	5765-26000	25332.25	-38.21	NA	0.151	NA	2.5	2.5	Pass
NVNT	a	5580	Ant3	30-5460	5460.00	-46.11	NA	0.0245	NA	2.5	2.5	Pass
NVNT	a	5580	Ant3	5460-5470	5460.45	-45.43	NA	0.0286	NA	12.5	12.5	Pass
NVNT	a	5580	Ant3	5745-5765	5745.96	-47.41	NA	0.0182	NA	12.5	12.5	Pass
NVNT	a	5580	Ant3	5765-26000	24664.49	-37.46	NA	0.1795	NA	2.5	2.5	Pass
NVNT	a	5720	Ant3	30-5460	3505.20	-37.04	NA	0.1977	NA	2.5	2.5	Pass
NVNT	a	5720	Ant3	5460-5470	5469.87	-48.54	NA	0.014	NA	12.5	12.5	Pass
NVNT	a	5720	Ant3	5745-5765	5748.78	-31.51	NA	0.7063	NA	12.5	12.5	Pass
NVNT	a	5720	Ant3	5765-26000	25089.43	-38.02	NA	0.1578	NA	2.5	2.5	Pass

NVNT	ac20	5500	Ant1	30-5460	5454.57	-47.06	NA	0.0197	NA	2.5	2.5	Pass
NVNT	ac20	5500	Ant1	5460-5470	5460.10	-47.55	NA	0.0176	NA	12.5	12.5	Pass
NVNT	ac20	5500	Ant1	5745-5765	5747.96	-50.27	NA	0.0094	NA	12.5	12.5	Pass
NVNT	ac20	5500	Ant1	5765-26000	25312.01	-38.30	NA	0.1479	NA	2.5	2.5	Pass
NVNT	ac20	5500	Ant2	30-5460	5411.13	-47.37	NA	0.0183	NA	2.5	2.5	Pass
NVNT	ac20	5500	Ant2	5460-5470	5461.52	-46.60	NA	0.0219	NA	12.5	12.5	Pass
NVNT	ac20	5500	Ant2	5745-5765	5757.30	-49.26	NA	0.0119	NA	12.5	12.5	Pass
NVNT	ac20	5500	Ant2	5765-26000	24684.73	-37.64	NA	0.1722	NA	2.5	2.5	Pass
NVNT	ac20	5500	Ant3	30-5460	5460.00	-45.52	NA	0.0281	NA	2.5	2.5	Pass
NVNT	ac20	5500	Ant3	5460-5470	5460.39	-46.78	NA	0.021	NA	12.5	12.5	Pass
NVNT	ac20	5500	Ant3	5745-5765	5746.70	-48.96	NA	0.0127	NA	12.5	12.5	Pass
NVNT	ac20	5500	Ant3	5765-26000	25736.95	-38.20	NA	0.1514	NA	2.5	2.5	Pass
NVNT	ac20	5580	Ant1	30-5460	3488.91	-47.42	NA	0.0181	NA	2.5	2.5	Pass
NVNT	ac20	5580	Ant1	5460-5470	5460.33	-46.96	NA	0.0201	NA	12.5	12.5	Pass
NVNT	ac20	5580	Ant1	5745-5765	5750.28	-49.01	NA	0.0126	NA	12.5	12.5	Pass
NVNT	ac20	5580	Ant1	5765-26000	24684.73	-38.46	NA	0.1426	NA	2.5	2.5	Pass
NVNT	ac20	5580	Ant2	30-5460	3407.46	-43.25	NA	0.0473	NA	2.5	2.5	Pass
NVNT	ac20	5580	Ant2	5460-5470	5460.04	-47.04	NA	0.0198	NA	12.5	12.5	Pass
NVNT	ac20	5580	Ant2	5745-5765	5753.86	-48.43	NA	0.0144	NA	12.5	12.5	Pass
NVNT	ac20	5580	Ant2	5765-26000	25352.48	-38.02	NA	0.1578	NA	2.5	2.5	Pass
NVNT	ac20	5580	Ant3	30-5460	5460.00	-46.58	NA	0.022	NA	2.5	2.5	Pass
NVNT	ac20	5580	Ant3	5460-5470	5460.19	-47.40	NA	0.0182	NA	12.5	12.5	Pass
NVNT	ac20	5580	Ant3	5745-5765	5752.04	-48.33	NA	0.0147	NA	12.5	12.5	Pass
NVNT	ac20	5580	Ant3	5765-26000	24644.25	-37.73	NA	0.1687	NA	2.5	2.5	Pass
NVNT	ac20	5720	Ant1	30-5460	3141.39	-45.54	NA	0.0279	NA	2.5	2.5	Pass
NVNT	ac20	5720	Ant1	5460-5470	5468.76	-47.77	NA	0.0167	NA	12.5	12.5	Pass
NVNT	ac20	5720	Ant1	5745-5765	5745.10	-35.31	NA	0.2944	NA	12.5	12.5	Pass
NVNT	ac20	5720	Ant1	5765-26000	25352.48	-37.20	NA	0.1905	NA	2.5	2.5	Pass
NVNT	ac20	5720	Ant2	30-5460	3494.34	-43.06	NA	0.0494	NA	2.5	2.5	Pass
NVNT	ac20	5720	Ant2	5460-5470	5469.02	-49.78	NA	0.0105	NA	12.5	12.5	Pass
NVNT	ac20	5720	Ant2	5745-5765	5754.30	-36.72	NA	0.2128	NA	12.5	12.5	Pass
NVNT	ac20	5720	Ant2	5765-26000	24644.25	-37.70	NA	0.1698	NA	2.5	2.5	Pass
NVNT	ac20	5720	Ant3	30-5460	2777.58	-46.50	NA	0.0224	NA	2.5	2.5	Pass
NVNT	ac20	5720	Ant3	5460-5470	5461.07	-49.51	NA	0.0112	NA	12.5	12.5	Pass
NVNT	ac20	5720	Ant3	5745-5765	5757.80	-37.43	NA	0.1807	NA	12.5	12.5	Pass
NVNT	ac20	5720	Ant3	5765-26000	25190.60	-38.01	NA	0.1581	NA	2.5	2.5	Pass
NVNT	ac40	5510	Ant1	30-5460	3402.03	-43.43	NA	0.0454	NA	12.5	12.5	Pass
NVNT	ac40	5510	Ant1	5460-5470	5469.64	-46.87	NA	0.0206	NA	50	50	Pass
NVNT	ac40	5510	Ant1	5770-26000	25352.64	-38.25	NA	0.1496	NA	12.5	12.5	Pass
NVNT	ac40	5510	Ant2	30-5460	5449.14	-46.04	NA	0.0249	NA	12.5	12.5	Pass
NVNT	ac40	5510	Ant2	5460-5470	5470.00	-44.88	NA	0.0325	NA	50	50	Pass
NVNT	ac40	5510	Ant2	5770-26000	24685.05	-37.54	NA	0.1762	NA	12.5	12.5	Pass

NVNT	ac40	5510	Ant3	30-5460	3304.29	-46.22	NA	0.0239	NA	12.5	12.5	Pass
NVNT	ac40	5510	Ant3	5460-5470	5469.76	-45.32	NA	0.0294	NA	50	50	Pass
NVNT	ac40	5510	Ant3	5770-26000	24685.05	-37.22	NA	0.1897	NA	12.5	12.5	Pass
NVNT	ac40	5590	Ant1	30-5460	3505.20	-44.21	NA	0.0379	NA	12.5	12.5	Pass
NVNT	ac40	5590	Ant1	5460-5470	5469.85	-47.56	NA	0.0175	NA	50	50	Pass
NVNT	ac40	5590	Ant1	5770-26000	25271.72	-38.52	NA	0.1406	NA	12.5	12.5	Pass
NVNT	ac40	5590	Ant2	30-5460	2630.97	-46.67	NA	0.0215	NA	12.5	12.5	Pass
NVNT	ac40	5590	Ant2	5460-5470	5469.69	-46.30	NA	0.0234	NA	50	50	Pass
NVNT	ac40	5590	Ant2	5770-26000	25878.62	-37.86	NA	0.1637	NA	12.5	12.5	Pass
NVNT	ac40	5590	Ant3	30-5460	2473.50	-45.59	NA	0.0276	NA	12.5	12.5	Pass
NVNT	ac40	5590	Ant3	5460-5470	5469.97	-46.76	NA	0.0211	NA	50	50	Pass
NVNT	ac40	5590	Ant3	5770-26000	25372.87	-38.06	NA	0.1563	NA	12.5	12.5	Pass
NVNT	ac40	5710	Ant1	30-5460	2473.50	-44.00	NA	0.0398	NA	12.5	12.5	Pass
NVNT	ac40	5710	Ant1	5460-5470	5467.72	-48.70	NA	0.0135	NA	50	50	Pass
NVNT	ac40	5710	Ant1	5770-26000	25352.64	-37.01	NA	0.1991	NA	12.5	12.5	Pass
NVNT	ac40	5710	Ant2	30-5460	3260.85	-47.59	NA	0.0174	NA	12.5	12.5	Pass
NVNT	ac40	5710	Ant2	5460-5470	5466.08	-49.72	NA	0.0107	NA	50	50	Pass
NVNT	ac40	5710	Ant2	5770-26000	24664.82	-38.22	NA	0.1507	NA	12.5	12.5	Pass
NVNT	ac40	5710	Ant3	30-5460	2473.50	-45.85	NA	0.026	NA	12.5	12.5	Pass
NVNT	ac40	5710	Ant3	5460-5470	5468.86	-48.66	NA	0.0136	NA	50	50	Pass
NVNT	ac40	5710	Ant3	5770-26000	25312.18	-37.56	NA	0.1754	NA	12.5	12.5	Pass
NVNT	ac80	5530	Ant1	30-5460	5460.00	-42.66	NA	0.0542	NA	12.5	12.5	Pass
NVNT	ac80	5530	Ant1	5460-5469.5	5469.46	-41.54	NA	0.0701	NA	50	50	Pass
NVNT	ac80	5530	Ant1	5469.5-5470	5469.51	-39.89	NA	0.1026	NA	51.2	51.2	Pass
NVNT	ac80	5530	Ant1	5770-26000	25332.41	-38.21	NA	0.151	NA	12.5	12.5	Pass
NVNT	ac80	5530	Ant2	30-5460	5460.00	-41.52	NA	0.0705	NA	12.5	12.5	Pass
NVNT	ac80	5530	Ant2	5460-5469.5	5469.26	-40.23	NA	0.0948	NA	50	50	Pass
NVNT	ac80	5530	Ant2	5469.5-5470	5469.98	-39.13	NA	0.1222	NA	51.2	51.2	Pass
NVNT	ac80	5530	Ant2	5770-26000	24705.28	-38.33	NA	0.1469	NA	12.5	12.5	Pass
NVNT	ac80	5530	Ant3	30-5460	5460.00	-42.66	NA	0.0542	NA	12.5	12.5	Pass
NVNT	ac80	5530	Ant3	5460-5469.5	5468.94	-40.83	NA	0.0826	NA	50	50	Pass
NVNT	ac80	5530	Ant3	5469.5-5470	5469.98	-38.61	NA	0.1377	NA	51.2	51.2	Pass
NVNT	ac80	5530	Ant3	5770-26000	24907.58	-37.75	NA	0.1679	NA	12.5	12.5	Pass
NVNT	ac80	5610	Ant1	30-5460	2473.50	-43.89	NA	0.0408	NA	12.5	12.5	Pass
NVNT	ac80	5610	Ant1	5460-5469.5	5469.41	-48.70	NA	0.0135	NA	50	50	Pass
NVNT	ac80	5610	Ant1	5469.5-5470	5469.77	-48.53	NA	0.014	NA	51.2	51.2	Pass
NVNT	ac80	5610	Ant1	5770-26000	24685.05	-38.49	NA	0.1416	NA	12.5	12.5	Pass
NVNT	ac80	5610	Ant2	30-5460	2468.07	-46.67	NA	0.0215	NA	12.5	12.5	Pass
NVNT	ac80	5610	Ant2	5460-5469.5	5466.27	-47.65	NA	0.0172	NA	50	50	Pass
NVNT	ac80	5610	Ant2	5469.5-5470	5469.97	-47.92	NA	0.0161	NA	51.2	51.2	Pass
NVNT	ac80	5610	Ant2	5770-26000	25312.18	-37.96	NA	0.16	NA	12.5	12.5	Pass
NVNT	ac80	5610	Ant3	30-5460	5460.00	-46.31	NA	0.0234	NA	12.5	12.5	Pass

NVNT	ac80	5610	Ant3	5460-5469.5	5466.85	-47.68	NA	0.0171	NA	50	50	Pass
NVNT	ac80	5610	Ant3	5469.5-5470	5469.78	-47.21	NA	0.019	NA	51.2	51.2	Pass
NVNT	ac80	5610	Ant3	5770-26000	25352.64	-37.28	NA	0.1871	NA	12.5	12.5	Pass
NVNT	ac80	5690	Ant1	30-5460	2468.07	-40.25	NA	0.0944	NA	12.5	12.5	Pass
NVNT	ac80	5690	Ant1	5460-5469.5	5460.82	-47.26	NA	0.0188	NA	50	50	Pass
NVNT	ac80	5690	Ant1	5469.5-5470	5469.63	-47.98	NA	0.0159	NA	51.2	51.2	Pass
NVNT	ac80	5690	Ant1	5770-26000	25109.88	-37.12	NA	0.1941	NA	12.5	12.5	Pass
NVNT	ac80	5690	Ant2	30-5460	2473.50	-46.56	NA	0.0221	NA	12.5	12.5	Pass
NVNT	ac80	5690	Ant2	5460-5469.5	5467.41	-48.18	NA	0.0152	NA	50	50	Pass
NVNT	ac80	5690	Ant2	5469.5-5470	5469.86	-49.06	NA	0.0124	NA	51.2	51.2	Pass
NVNT	ac80	5690	Ant2	5770-26000	25372.87	-37.67	NA	0.171	NA	12.5	12.5	Pass
NVNT	ac80	5690	Ant3	30-5460	2468.07	-47.36	NA	0.0184	NA	12.5	12.5	Pass
NVNT	ac80	5690	Ant3	5460-5469.5	5467.09	-48.77	NA	0.0133	NA	50	50	Pass
NVNT	ac80	5690	Ant3	5469.5-5470	5469.57	-48.49	NA	0.0142	NA	51.2	51.2	Pass
NVNT	ac80	5690	Ant3	5770-26000	25372.87	-38.23	NA	0.1503	NA	12.5	12.5	Pass
NVNT	ax20	5500	Ant1	30-5460	2468.07	-42.44	NA	0.057	NA	2.5	2.5	Pass
NVNT	ax20	5500	Ant1	5460-5470	5460.03	-46.67	NA	0.0215	NA	12.5	12.5	Pass
NVNT	ax20	5500	Ant1	5745-5765	5752.80	-49.39	NA	0.0115	NA	12.5	12.5	Pass
NVNT	ax20	5500	Ant1	5765-26000	24644.25	-39.06	NA	0.1242	NA	2.5	2.5	Pass
NVNT	ax20	5500	Ant2	30-5460	2473.50	-43.60	NA	0.0437	NA	2.5	2.5	Pass
NVNT	ax20	5500	Ant2	5460-5470	5460.11	-45.57	NA	0.0277	NA	12.5	12.5	Pass
NVNT	ax20	5500	Ant2	5745-5765	5754.46	-48.95	NA	0.0127	NA	12.5	12.5	Pass
NVNT	ax20	5500	Ant2	5765-26000	25312.01	-38.47	NA	0.1422	NA	2.5	2.5	Pass
NVNT	ax20	5500	Ant3	30-5460	5460.00	-45.23	NA	0.03	NA	2.5	2.5	Pass
NVNT	ax20	5500	Ant3	5460-5470	5463.11	-46.26	NA	0.0237	NA	12.5	12.5	Pass
NVNT	ax20	5500	Ant3	5745-5765	5757.46	-49.05	NA	0.0124	NA	12.5	12.5	Pass
NVNT	ax20	5500	Ant3	5765-26000	25231.07	-37.51	NA	0.1774	NA	2.5	2.5	Pass
NVNT	ax20	5580	Ant1	30-5460	2468.07	-40.61	NA	0.0869	NA	2.5	2.5	Pass
NVNT	ax20	5580	Ant1	5460-5470	5460.15	-47.54	NA	0.0176	NA	12.5	12.5	Pass
NVNT	ax20	5580	Ant1	5745-5765	5746.14	-48.99	NA	0.0126	NA	12.5	12.5	Pass
NVNT	ax20	5580	Ant1	5765-26000	25332.25	-37.96	NA	0.16	NA	2.5	2.5	Pass
NVNT	ax20	5580	Ant2	30-5460	5460.00	-46.62	NA	0.0218	NA	2.5	2.5	Pass
NVNT	ax20	5580	Ant2	5460-5470	5460.09	-47.34	NA	0.0185	NA	12.5	12.5	Pass
NVNT	ax20	5580	Ant2	5745-5765	5760.78	-48.77	NA	0.0133	NA	12.5	12.5	Pass
NVNT	ax20	5580	Ant2	5765-26000	25352.48	-38.12	NA	0.1542	NA	2.5	2.5	Pass
NVNT	ax20	5580	Ant3	30-5460	1756.74	-44.01	NA	0.0397	NA	2.5	2.5	Pass
NVNT	ax20	5580	Ant3	5460-5470	5460.10	-46.93	NA	0.0203	NA	12.5	12.5	Pass
NVNT	ax20	5580	Ant3	5745-5765	5757.82	-47.55	NA	0.0176	NA	12.5	12.5	Pass
NVNT	ax20	5580	Ant3	5765-26000	25372.72	-37.74	NA	0.1683	NA	2.5	2.5	Pass
NVNT	ax20	5720	Ant1	30-5460	2473.50	-40.83	NA	0.0826	NA	2.5	2.5	Pass
NVNT	ax20	5720	Ant1	5460-5470	5465.30	-47.18	NA	0.0191	NA	12.5	12.5	Pass
NVNT	ax20	5720	Ant1	5745-5765	5748.02	-36.65	NA	0.2163	NA	12.5	12.5	Pass

NVNT	ax20	5720	Ant1	5765-26000	25332.25	-37.39	NA	0.1824	NA	2.5	2.5	Pass
NVNT	ax20	5720	Ant2	30-5460	2489.79	-46.97	NA	0.0201	NA	2.5	2.5	Pass
NVNT	ax20	5720	Ant2	5460-5470	5467.06	-49.88	NA	0.0103	NA	12.5	12.5	Pass
NVNT	ax20	5720	Ant2	5745-5765	5747.88	-36.87	NA	0.2056	NA	12.5	12.5	Pass
NVNT	ax20	5720	Ant2	5765-26000	25332.25	-37.85	NA	0.1641	NA	2.5	2.5	Pass
NVNT	ax20	5720	Ant3	30-5460	3152.25	-46.34	NA	0.0232	NA	2.5	2.5	Pass
NVNT	ax20	5720	Ant3	5460-5470	5463.41	-49.27	NA	0.0118	NA	12.5	12.5	Pass
NVNT	ax20	5720	Ant3	5745-5765	5745.58	-37.34	NA	0.1845	NA	12.5	12.5	Pass
NVNT	ax20	5720	Ant3	5765-26000	24603.79	-37.91	NA	0.1618	NA	2.5	2.5	Pass
NVNT	ax40	5510	Ant1	30-5460	2468.07	-45.40	NA	0.0288	NA	12.5	12.5	Pass
NVNT	ax40	5510	Ant1	5460-5470	5469.85	-45.54	NA	0.0279	NA	50	50	Pass
NVNT	ax40	5510	Ant1	5770-26000	24725.51	-38.42	NA	0.1439	NA	12.5	12.5	Pass
NVNT	ax40	5510	Ant2	30-5460	2468.07	-46.30	NA	0.0234	NA	12.5	12.5	Pass
NVNT	ax40	5510	Ant2	5460-5470	5469.80	-45.55	NA	0.0279	NA	50	50	Pass
NVNT	ax40	5510	Ant2	5770-26000	25312.18	-37.91	NA	0.1618	NA	12.5	12.5	Pass
NVNT	ax40	5510	Ant3	30-5460	5432.85	-47.17	NA	0.0192	NA	12.5	12.5	Pass
NVNT	ax40	5510	Ant3	5460-5470	5469.74	-44.58	NA	0.0348	NA	50	50	Pass
NVNT	ax40	5510	Ant3	5770-26000	25170.57	-38.21	NA	0.151	NA	12.5	12.5	Pass
NVNT	ax40	5590	Ant1	30-5460	2674.41	-47.97	NA	0.016	NA	12.5	12.5	Pass
NVNT	ax40	5590	Ant1	5460-5470	5469.36	-47.59	NA	0.0174	NA	50	50	Pass
NVNT	ax40	5590	Ant1	5770-26000	25352.64	-38.39	NA	0.1449	NA	12.5	12.5	Pass
NVNT	ax40	5590	Ant2	30-5460	3059.94	-46.43	NA	0.0228	NA	12.5	12.5	Pass
NVNT	ax40	5590	Ant2	5460-5470	5469.95	-46.78	NA	0.021	NA	50	50	Pass
NVNT	ax40	5590	Ant2	5770-26000	25352.64	-37.22	NA	0.1897	NA	12.5	12.5	Pass
NVNT	ax40	5590	Ant3	30-5460	3260.85	-47.14	NA	0.0193	NA	12.5	12.5	Pass
NVNT	ax40	5590	Ant3	5460-5470	5469.99	-45.78	NA	0.0264	NA	50	50	Pass
NVNT	ax40	5590	Ant3	5770-26000	25817.93	-37.39	NA	0.1824	NA	12.5	12.5	Pass
NVNT	ax40	5710	Ant1	30-5460	2772.15	-46.53	NA	0.0222	NA	12.5	12.5	Pass
NVNT	ax40	5710	Ant1	5460-5470	5467.66	-48.07	NA	0.0156	NA	50	50	Pass
NVNT	ax40	5710	Ant1	5770-26000	24685.05	-36.91	NA	0.2037	NA	12.5	12.5	Pass
NVNT	ax40	5710	Ant2	30-5460	3146.82	-47.12	NA	0.0194	NA	12.5	12.5	Pass
NVNT	ax40	5710	Ant2	5460-5470	5469.97	-49.19	NA	0.0121	NA	50	50	Pass
NVNT	ax40	5710	Ant2	5770-26000	25312.18	-37.87	NA	0.1633	NA	12.5	12.5	Pass
NVNT	ax40	5710	Ant3	30-5460	5432.85	-46.79	NA	0.0209	NA	12.5	12.5	Pass
NVNT	ax40	5710	Ant3	5460-5470	5465.50	-49.28	NA	0.0118	NA	50	50	Pass
NVNT	ax40	5710	Ant3	5770-26000	25352.64	-37.95	NA	0.1603	NA	12.5	12.5	Pass
NVNT	ax80	5530	Ant1	30-5460	5460.00	-43.43	NA	0.0454	NA	12.5	12.5	Pass
NVNT	ax80	5530	Ant1	5460-5469.5	5465.66	-41.90	NA	0.0646	NA	50	50	Pass
NVNT	ax80	5530	Ant1	5469.5-5470	5469.91	-40.28	NA	0.0938	NA	51.2	51.2	Pass
NVNT	ax80	5530	Ant1	5770-26000	25372.87	-38.90	NA	0.1288	NA	12.5	12.5	Pass
NVNT	ax80	5530	Ant2	30-5460	5454.57	-42.76	NA	0.053	NA	12.5	12.5	Pass
NVNT	ax80	5530	Ant2	5460-5469.5	5469.45	-40.47	NA	0.0897	NA	50	50	Pass

NVNT	ax80	5530	Ant2	5469.5-5470	5469.76	-38.32	NA	0.1472	NA	51.2	51.2	Pass
NVNT	ax80	5530	Ant2	5770-26000	24685.05	-38.42	NA	0.1439	NA	12.5	12.5	Pass
NVNT	ax80	5530	Ant3	30-5460	5460.00	-43.47	NA	0.045	NA	12.5	12.5	Pass
NVNT	ax80	5530	Ant3	5460-5469.5	5469.14	-40.05	NA	0.0989	NA	50	50	Pass
NVNT	ax80	5530	Ant3	5469.5-5470	5469.79	-38.72	NA	0.1343	NA	51.2	51.2	Pass
NVNT	ax80	5530	Ant3	5770-26000	24685.05	-38.49	NA	0.1416	NA	12.5	12.5	Pass
NVNT	ax80	5610	Ant1	30-5460	3087.09	-47.46	NA	0.0179	NA	12.5	12.5	Pass
NVNT	ax80	5610	Ant1	5460-5469.5	5466.69	-48.84	NA	0.0131	NA	50	50	Pass
NVNT	ax80	5610	Ant1	5469.5-5470	5469.90	-48.29	NA	0.0148	NA	51.2	51.2	Pass
NVNT	ax80	5610	Ant1	5770-26000	24705.28	-38.83	NA	0.1309	NA	12.5	12.5	Pass
NVNT	ax80	5610	Ant2	30-5460	2690.70	-46.58	NA	0.022	NA	12.5	12.5	Pass
NVNT	ax80	5610	Ant2	5460-5469.5	5461.82	-46.58	NA	0.022	NA	50	50	Pass
NVNT	ax80	5610	Ant2	5469.5-5470	5469.65	-47.85	NA	0.0164	NA	51.2	51.2	Pass
NVNT	ax80	5610	Ant2	5770-26000	24988.50	-37.98	NA	0.1592	NA	12.5	12.5	Pass
NVNT	ax80	5610	Ant3	30-5460	3141.39	-46.40	NA	0.0229	NA	12.5	12.5	Pass
NVNT	ax80	5610	Ant3	5460-5469.5	5467.10	-47.88	NA	0.0163	NA	50	50	Pass
NVNT	ax80	5610	Ant3	5469.5-5470	5469.84	-47.73	NA	0.0169	NA	51.2	51.2	Pass
NVNT	ax80	5610	Ant3	5770-26000	25817.93	-37.73	NA	0.1687	NA	12.5	12.5	Pass
NVNT	ax80	5690	Ant1	30-5460	3369.45	-45.90	NA	0.0257	NA	12.5	12.5	Pass
NVNT	ax80	5690	Ant1	5460-5469.5	5462.05	-48.64	NA	0.0137	NA	50	50	Pass
NVNT	ax80	5690	Ant1	5469.5-5470	5469.94	-47.99	NA	0.0159	NA	51.2	51.2	Pass
NVNT	ax80	5690	Ant1	5770-26000	25797.70	-36.37	NA	0.2307	NA	12.5	12.5	Pass
NVNT	ax80	5690	Ant2	30-5460	1756.74	-44.68	NA	0.034	NA	12.5	12.5	Pass
NVNT	ax80	5690	Ant2	5460-5469.5	5468.35	-48.58	NA	0.0139	NA	50	50	Pass
NVNT	ax80	5690	Ant2	5469.5-5470	5469.75	-49.06	NA	0.0124	NA	51.2	51.2	Pass
NVNT	ax80	5690	Ant2	5770-26000	24644.59	-38.24	NA	0.15	NA	12.5	12.5	Pass
NVNT	ax80	5690	Ant3	30-5460	2940.48	-47.15	NA	0.0193	NA	12.5	12.5	Pass
NVNT	ax80	5690	Ant3	5460-5469.5	5464.79	-48.66	NA	0.0136	NA	50	50	Pass
NVNT	ax80	5690	Ant3	5469.5-5470	5469.99	-49.26	NA	0.0119	NA	51.2	51.2	Pass
NVNT	ax80	5690	Ant3	5770-26000	24685.05	-37.98	NA	0.1592	NA	12.5	12.5	Pass
NVNT	n20	5500	Ant1	30-5460	5460.00	-46.10	NA	0.0245	NA	2.5	2.5	Pass
NVNT	n20	5500	Ant1	5460-5470	5460.24	-45.86	NA	0.0259	NA	12.5	12.5	Pass
NVNT	n20	5500	Ant1	5745-5765	5748.06	-50.11	NA	0.0097	NA	12.5	12.5	Pass
NVNT	n20	5500	Ant1	5765-26000	25251.31	-38.73	NA	0.134	NA	2.5	2.5	Pass
NVNT	n20	5500	Ant2	30-5460	5405.70	-46.80	NA	0.0209	NA	2.5	2.5	Pass
NVNT	n20	5500	Ant2	5460-5470	5460.28	-46.74	NA	0.0212	NA	12.5	12.5	Pass
NVNT	n20	5500	Ant2	5745-5765	5748.38	-49.21	NA	0.012	NA	12.5	12.5	Pass
NVNT	n20	5500	Ant2	5765-26000	24684.73	-38.06	NA	0.1563	NA	2.5	2.5	Pass
NVNT	n20	5500	Ant3	30-5460	2940.48	-46.94	NA	0.0202	NA	2.5	2.5	Pass
NVNT	n20	5500	Ant3	5460-5470	5460.00	-45.53	NA	0.028	NA	12.5	12.5	Pass
NVNT	n20	5500	Ant3	5745-5765	5747.74	-48.29	NA	0.0148	NA	12.5	12.5	Pass
NVNT	n20	5500	Ant3	5765-26000	24947.78	-38.14	NA	0.1535	NA	2.5	2.5	Pass

NVNT	n20	5580	Ant1	30-5460	2679.84	-47.88	NA	0.0163	NA	2.5	2.5	Pass
NVNT	n20	5580	Ant1	5460-5470	5460.09	-47.49	NA	0.0178	NA	12.5	12.5	Pass
NVNT	n20	5580	Ant1	5745-5765	5758.32	-49.47	NA	0.0113	NA	12.5	12.5	Pass
NVNT	n20	5580	Ant1	5765-26000	25312.01	-38.50	NA	0.1413	NA	2.5	2.5	Pass
NVNT	n20	5580	Ant2	30-5460	2587.53	-47.03	NA	0.0198	NA	2.5	2.5	Pass
NVNT	n20	5580	Ant2	5460-5470	5460.25	-47.61	NA	0.0173	NA	12.5	12.5	Pass
NVNT	n20	5580	Ant2	5745-5765	5745.04	-49.21	NA	0.012	NA	12.5	12.5	Pass
NVNT	n20	5580	Ant2	5765-26000	25332.25	-36.92	NA	0.2032	NA	2.5	2.5	Pass
NVNT	n20	5580	Ant3	30-5460	2793.87	-46.93	NA	0.0203	NA	2.5	2.5	Pass
NVNT	n20	5580	Ant3	5460-5470	5460.06	-47.91	NA	0.0162	NA	12.5	12.5	Pass
NVNT	n20	5580	Ant3	5745-5765	5749.22	-48.37	NA	0.0146	NA	12.5	12.5	Pass
NVNT	n20	5580	Ant3	5765-26000	24947.78	-37.36	NA	0.1837	NA	2.5	2.5	Pass
NVNT	n20	5720	Ant1	30-5460	3157.68	-46.12	NA	0.0244	NA	2.5	2.5	Pass
NVNT	n20	5720	Ant1	5460-5470	5461.97	-47.94	NA	0.0161	NA	12.5	12.5	Pass
NVNT	n20	5720	Ant1	5745-5765	5747.82	-36.95	NA	0.2018	NA	12.5	12.5	Pass
NVNT	n20	5720	Ant1	5765-26000	25109.66	-36.46	NA	0.2259	NA	2.5	2.5	Pass
NVNT	n20	5720	Ant2	30-5460	3190.26	-46.94	NA	0.0202	NA	2.5	2.5	Pass
NVNT	n20	5720	Ant2	5460-5470	5462.33	-49.27	NA	0.0118	NA	12.5	12.5	Pass
NVNT	n20	5720	Ant2	5745-5765	5753.30	-37.94	NA	0.1607	NA	12.5	12.5	Pass
NVNT	n20	5720	Ant2	5765-26000	25231.07	-37.63	NA	0.1726	NA	2.5	2.5	Pass
NVNT	n20	5720	Ant3	30-5460	2625.54	-46.54	NA	0.0222	NA	2.5	2.5	Pass
NVNT	n20	5720	Ant3	5460-5470	5463.01	-48.59	NA	0.0138	NA	12.5	12.5	Pass
NVNT	n20	5720	Ant3	5745-5765	5745.06	-38.69	NA	0.1352	NA	12.5	12.5	Pass
NVNT	n20	5720	Ant3	5765-26000	24664.49	-37.64	NA	0.1722	NA	2.5	2.5	Pass
NVNT	n40	5510	Ant1	30-5460	2473.50	-46.53	NA	0.0222	NA	12.5	12.5	Pass
NVNT	n40	5510	Ant1	5460-5470	5469.41	-47.08	NA	0.0196	NA	50	50	Pass
NVNT	n40	5510	Ant1	5770-26000	24685.05	-38.68	NA	0.1355	NA	12.5	12.5	Pass
NVNT	n40	5510	Ant2	30-5460	5416.56	-46.24	NA	0.0238	NA	12.5	12.5	Pass
NVNT	n40	5510	Ant2	5460-5470	5469.26	-45.19	NA	0.0303	NA	50	50	Pass
NVNT	n40	5510	Ant2	5770-26000	25979.77	-37.77	NA	0.1671	NA	12.5	12.5	Pass
NVNT	n40	5510	Ant3	30-5460	5383.98	-46.63	NA	0.0217	NA	12.5	12.5	Pass
NVNT	n40	5510	Ant3	5460-5470	5469.95	-45.27	NA	0.0297	NA	50	50	Pass
NVNT	n40	5510	Ant3	5770-26000	24664.82	-37.05	NA	0.1972	NA	12.5	12.5	Pass
NVNT	n40	5590	Ant1	30-5460	2614.68	-47.61	NA	0.0173	NA	12.5	12.5	Pass
NVNT	n40	5590	Ant1	5460-5470	5469.81	-47.87	NA	0.0163	NA	50	50	Pass
NVNT	n40	5590	Ant1	5770-26000	25332.41	-38.51	NA	0.1409	NA	12.5	12.5	Pass
NVNT	n40	5590	Ant2	30-5460	2473.50	-46.63	NA	0.0217	NA	12.5	12.5	Pass
NVNT	n40	5590	Ant2	5460-5470	5469.90	-46.84	NA	0.0207	NA	50	50	Pass
NVNT	n40	5590	Ant2	5770-26000	25352.64	-38.37	NA	0.1455	NA	12.5	12.5	Pass
NVNT	n40	5590	Ant3	30-5460	2668.98	-46.45	NA	0.0226	NA	12.5	12.5	Pass
NVNT	n40	5590	Ant3	5460-5470	5469.86	-46.98	NA	0.02	NA	50	50	Pass
NVNT	n40	5590	Ant3	5770-26000	25130.11	-37.81	NA	0.1656	NA	12.5	12.5	Pass




Report No.: AB26060362MW02

NVNT	n40	5710	Ant1	30-5460	3125.10	-46.20	NA	0.024	NA	12.5	12.5	Pass
NVNT	n40	5710	Ant1	5460-5470	5469.69	-48.15	NA	0.0153	NA	50	50	Pass
NVNT	n40	5710	Ant1	5770-26000	25716.78	-36.51	NA	0.2234	NA	12.5	12.5	Pass
NVNT	n40	5710	Ant2	30-5460	3233.70	-46.51	NA	0.0223	NA	12.5	12.5	Pass
NVNT	n40	5710	Ant2	5460-5470	5463.31	-48.88	NA	0.0129	NA	50	50	Pass
NVNT	n40	5710	Ant2	5770-26000	24685.05	-38.15	NA	0.1531	NA	12.5	12.5	Pass
NVNT	n40	5710	Ant3	30-5460	3027.36	-46.75	NA	0.0211	NA	12.5	12.5	Pass
NVNT	n40	5710	Ant3	5460-5470	5469.29	-49.32	NA	0.0117	NA	50	50	Pass
NVNT	n40	5710	Ant3	5770-26000	25352.64	-36.76	NA	0.2109	NA	12.5	12.5	Pass

Test Graphs


Tx. Spurious NVNT a 5500MHz Ant1 @ 30MHz-5460MHz

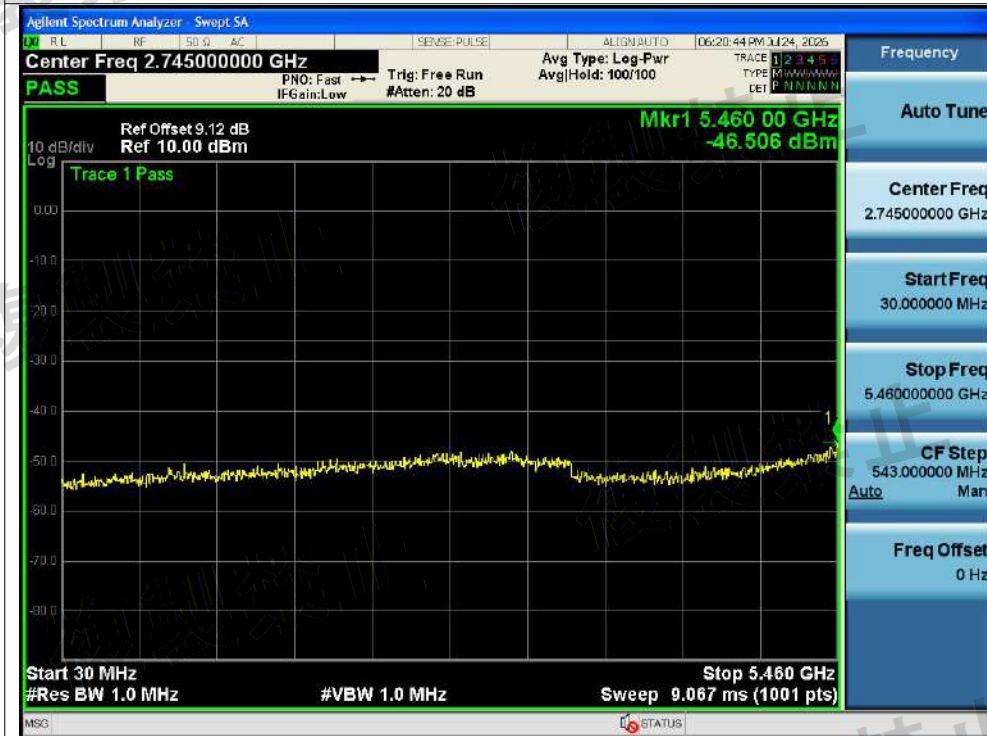

Tx. Spurious NVNT a 5500MHz Ant1 @ 5460MHz-5470MHz




Tx. Spurious NVNT a 5500MHz Ant1 @ 5745MHz-5765MHz

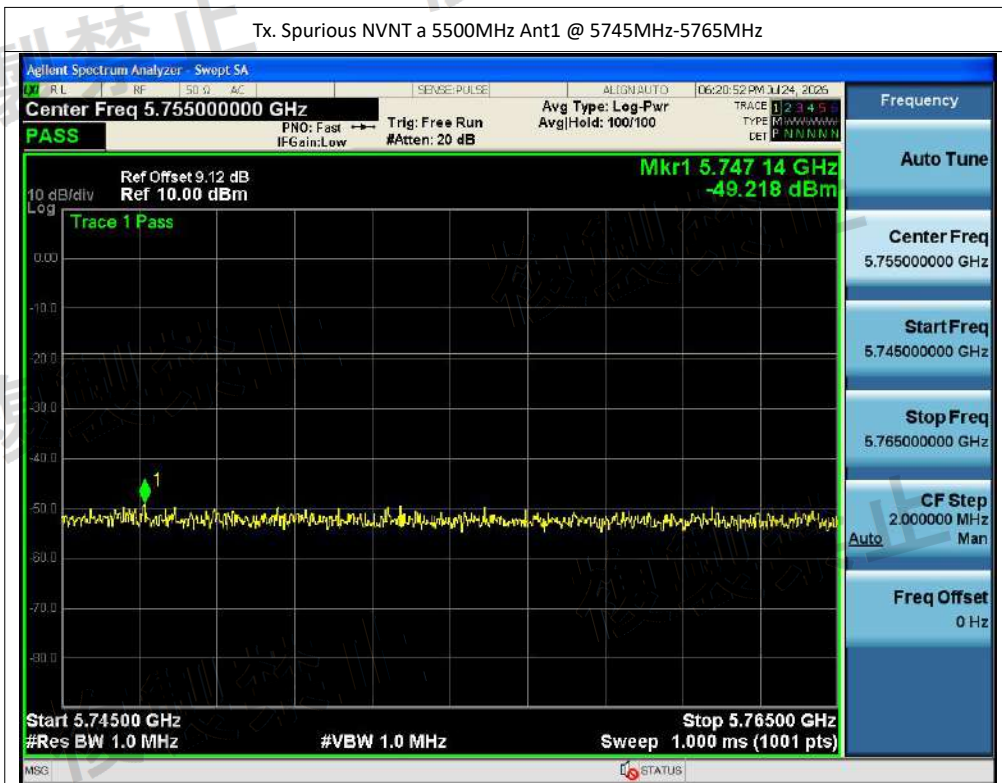


Tx. Spurious NVNT a 5500MHz Ant1 @ 5765MHz-26000MHz




Tx. Spurious NVNT a 5580MHz Ant1 @ 30MHz-5460MHz

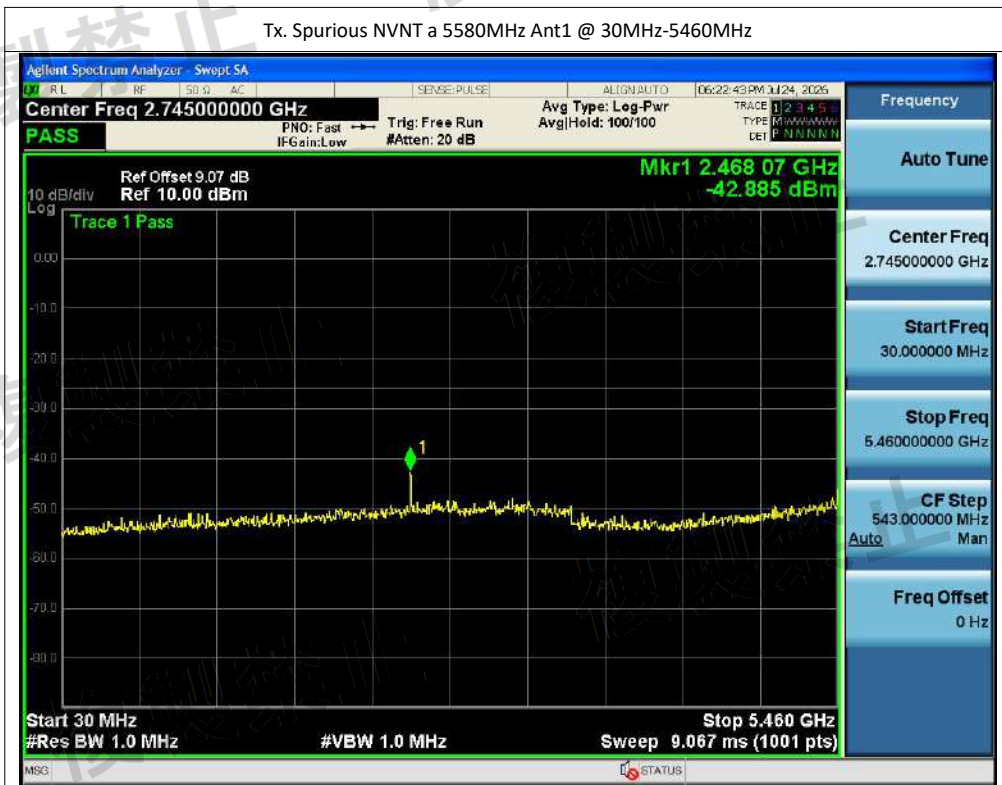

Tx. Spurious NVNT a 5580MHz Ant1 @ 5460MHz-5470MHz

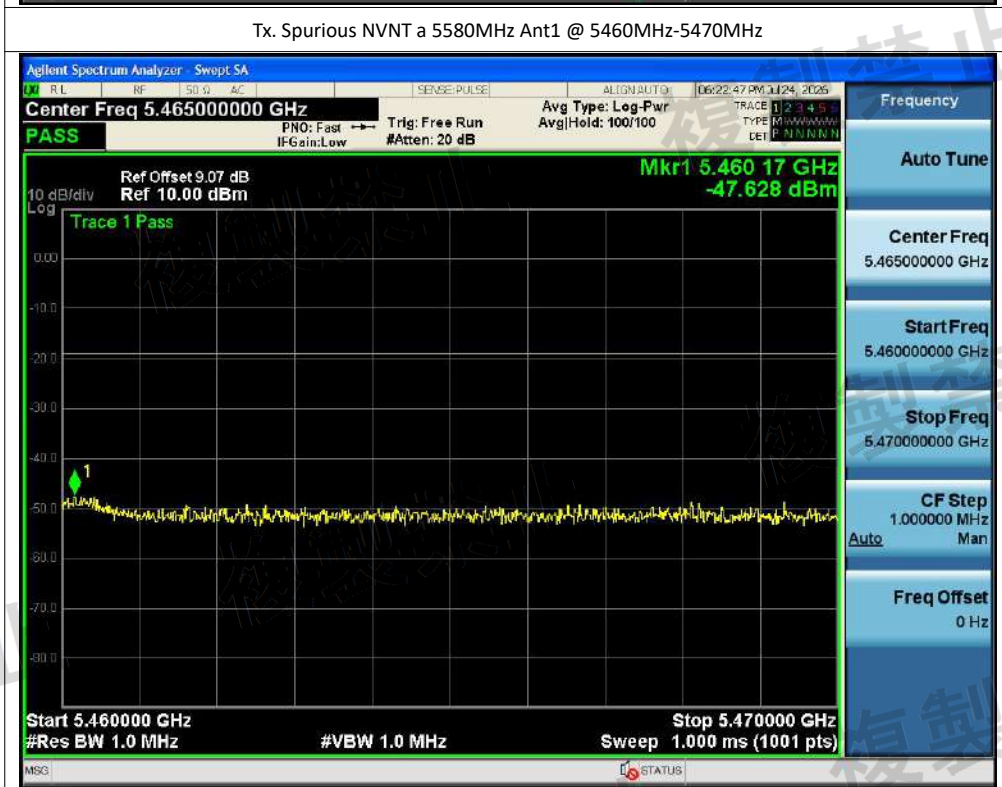

Tx. Spurious NVNT a 5580MHz Ant1 @ 5745MHz-5765MHz

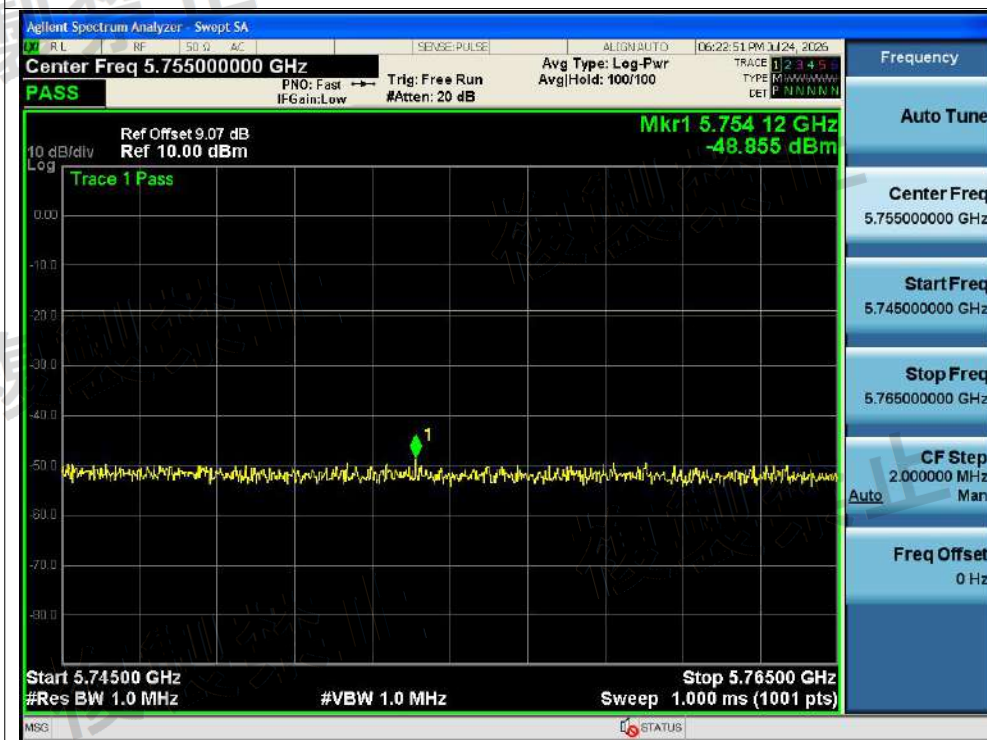


Tx. Spurious NVNT a 5580MHz Ant1 @ 5765MHz-26000MHz




Tx. Spurious NVNT a 5720MHz Ant1 @ 30MHz-5460MHz



Tx. Spurious NVNT a 5720MHz Ant1 @ 5460MHz-5470MHz

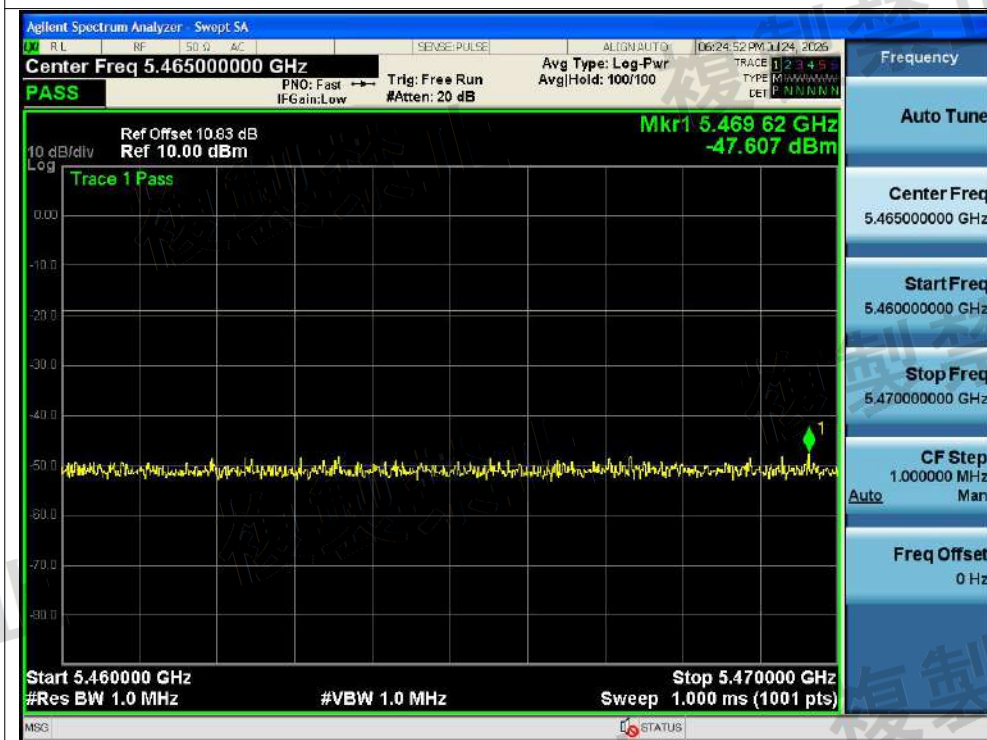

Tx. Spurious NVNT a 5720MHz Ant1 @ 5745MHz-5765MHz

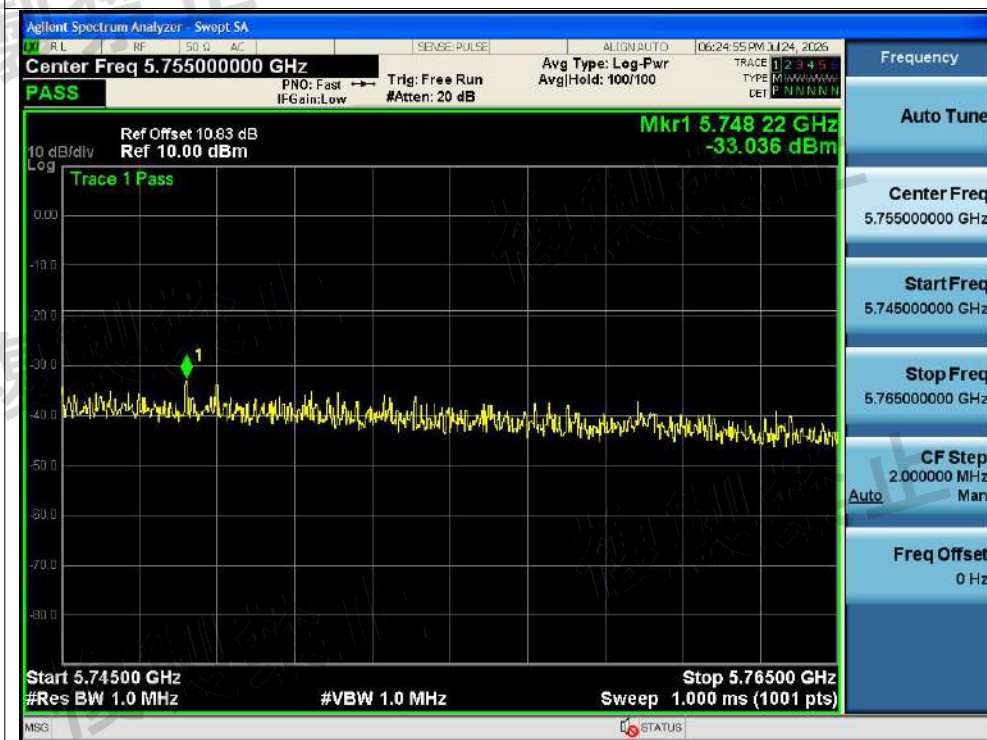


Tx. Spurious NVNT a 5720MHz Ant1 @ 5765MHz-26000MHz




Tx. Spurious NVNT a 5500MHz Ant2 @ 30MHz-5460MHz



Tx. Spurious NVNT a 5500MHz Ant2 @ 5460MHz-5470MHz

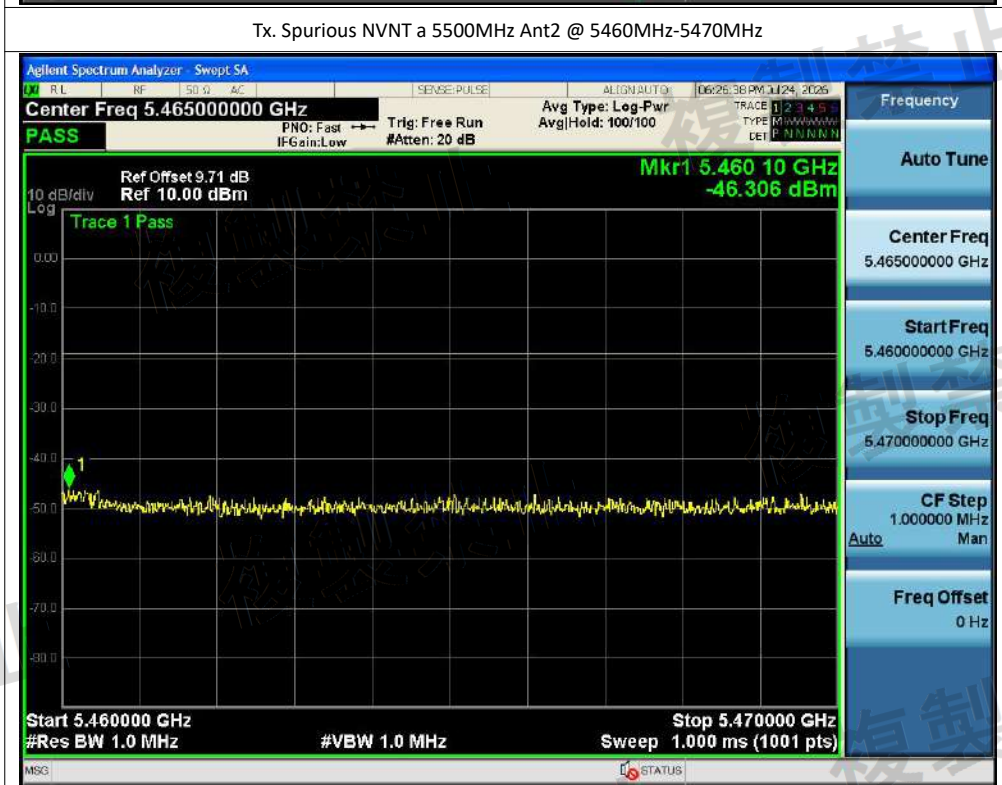


Tx. Spurious NVNT a 5500MHz Ant2 @ 5745MHz-5765MHz

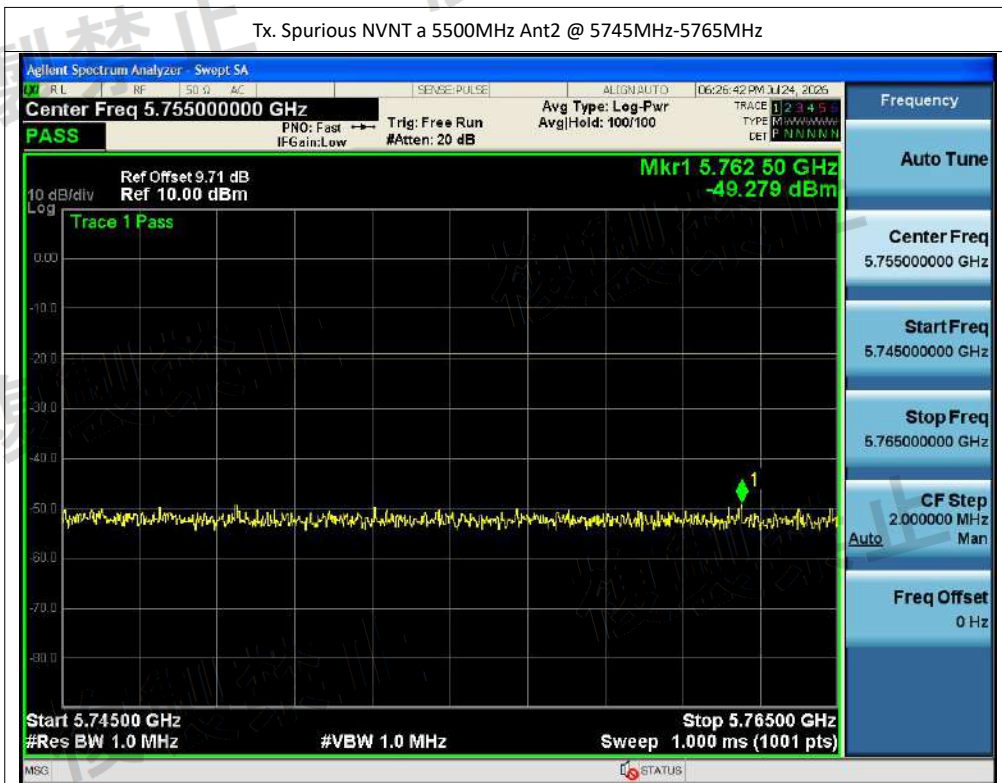

Tx. Spurious NVNT a 5500MHz Ant2 @ 5765MHz-26000MHz



Tx. Spurious NVNT a 5580MHz Ant2 @ 30MHz-5460MHz

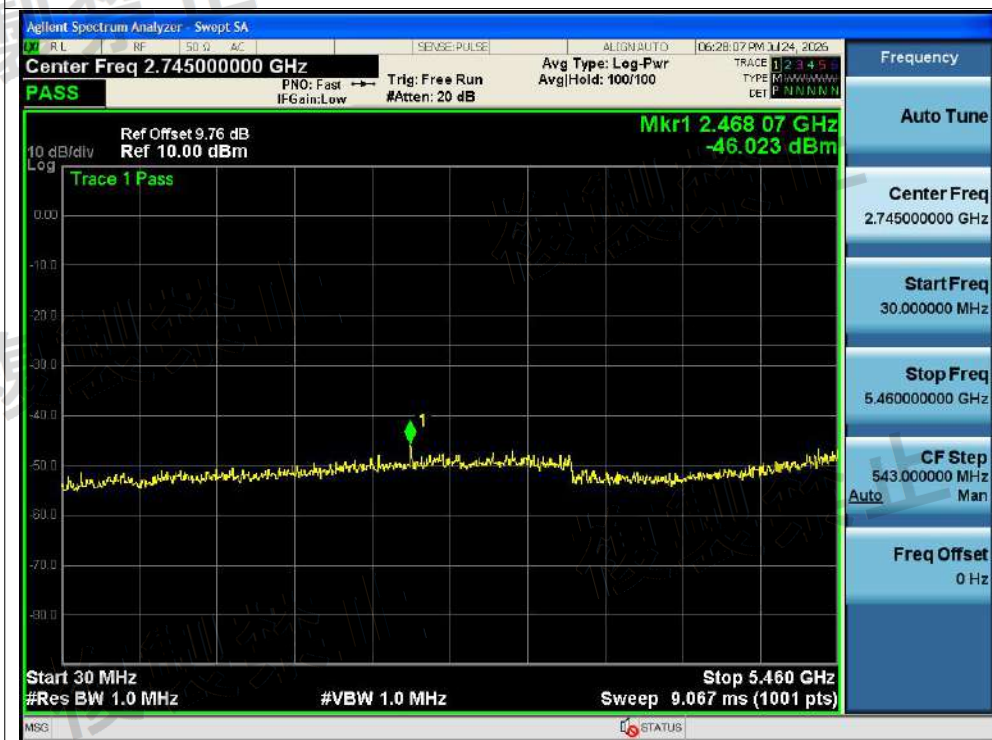

Tx. Spurious NVNT a 5580MHz Ant2 @ 5460MHz-5470MHz

