




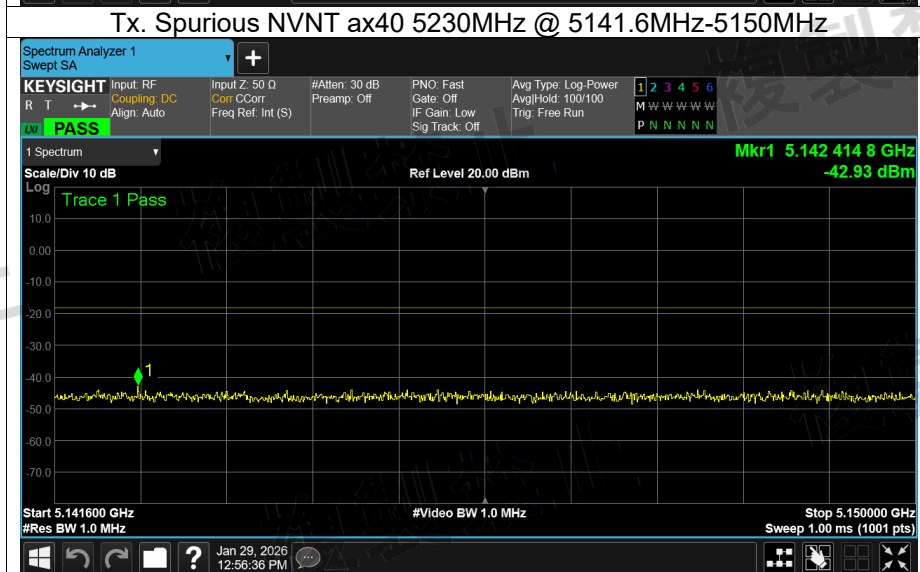
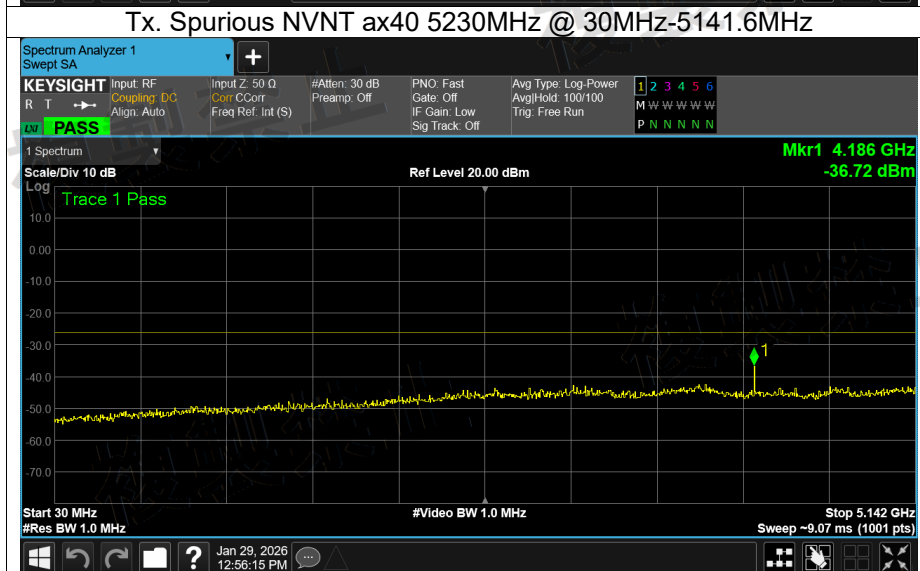
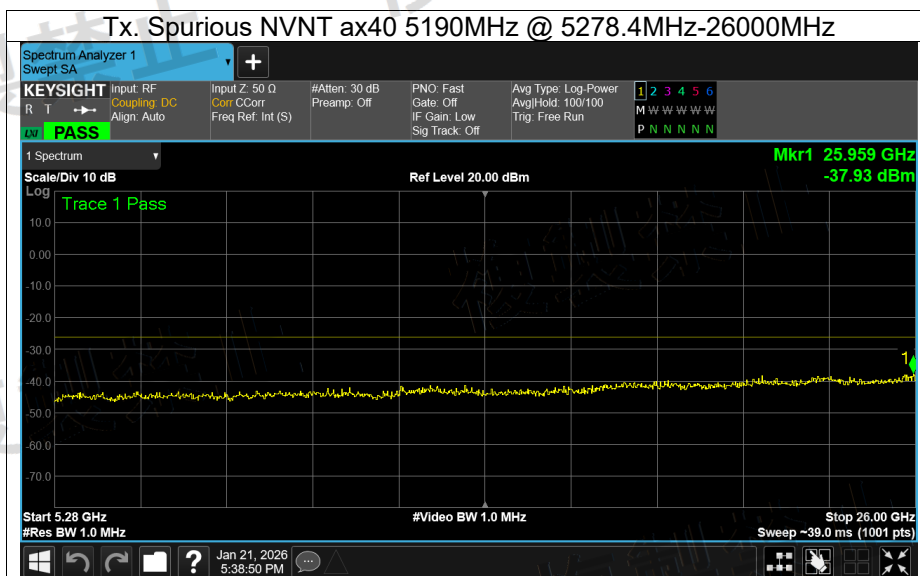
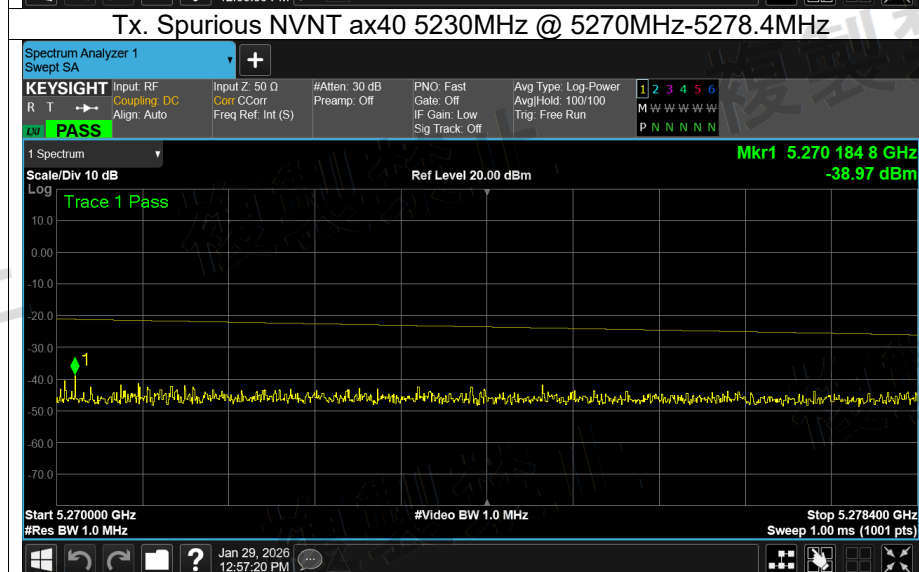
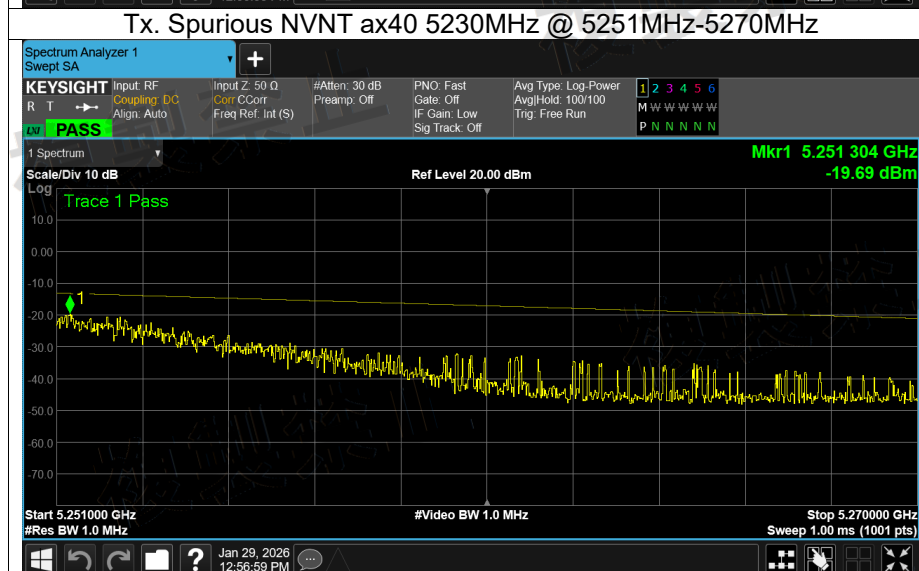
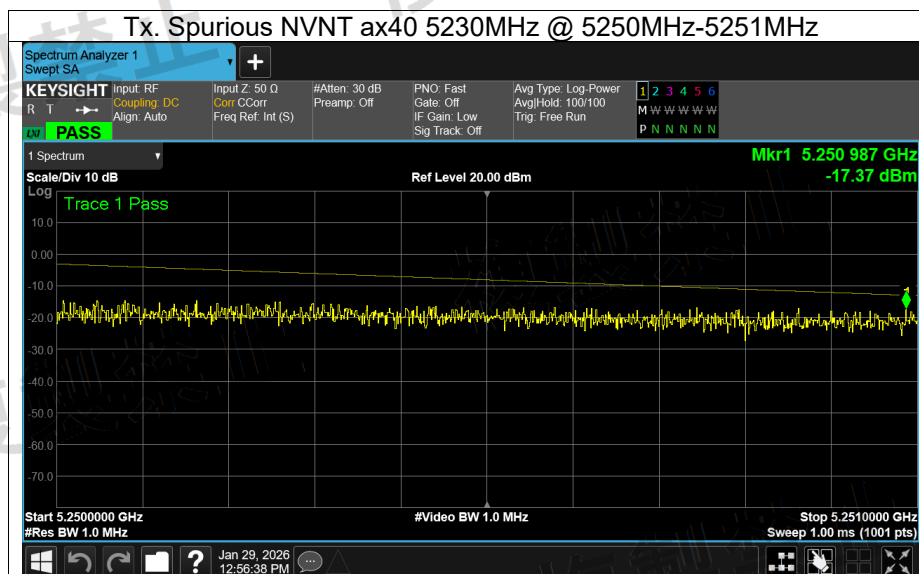
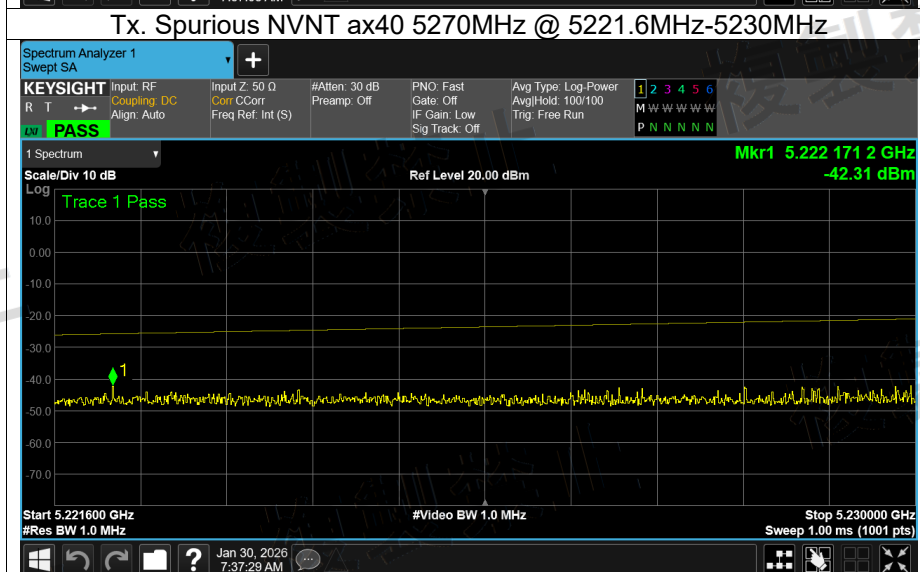
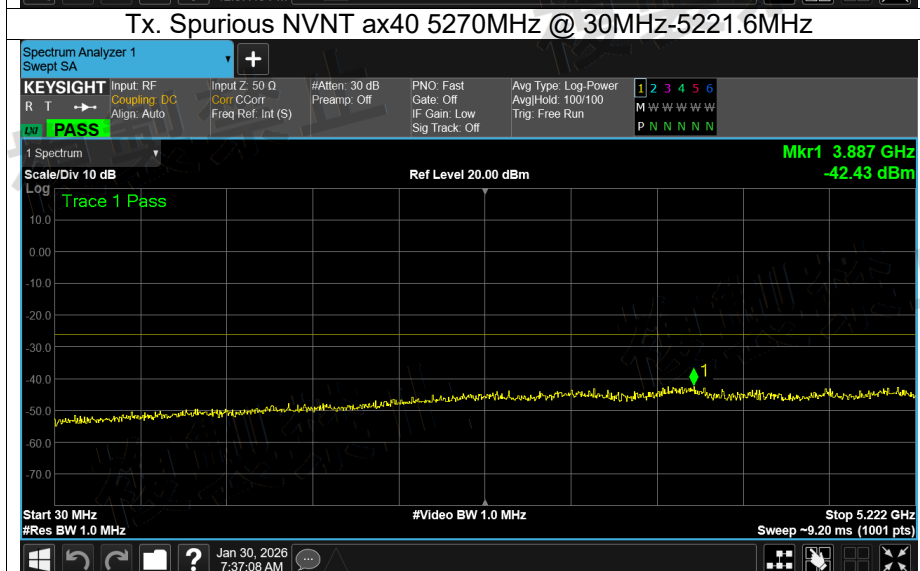
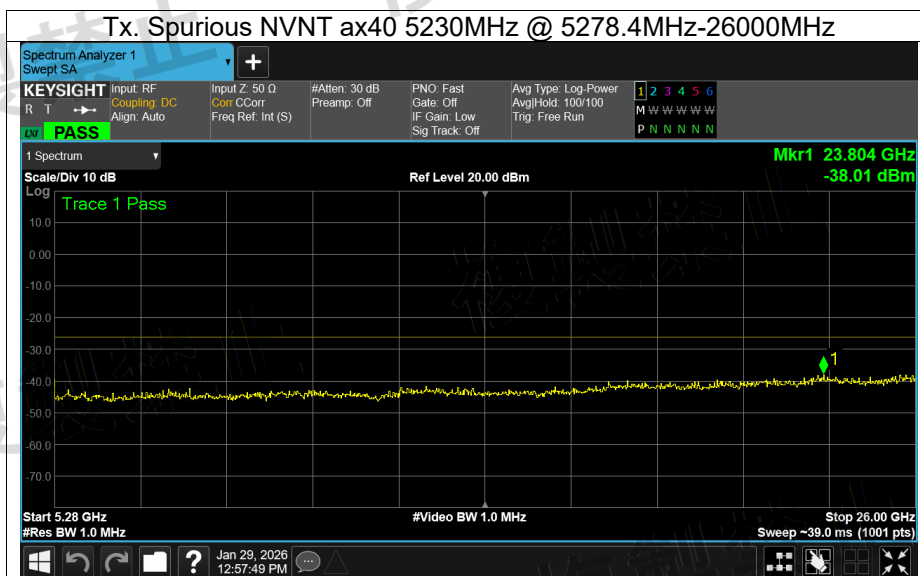
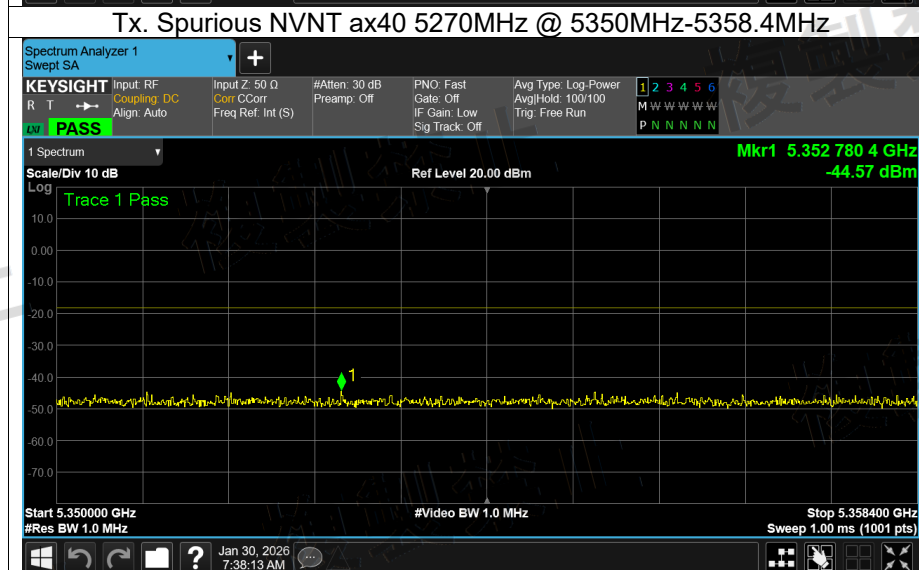




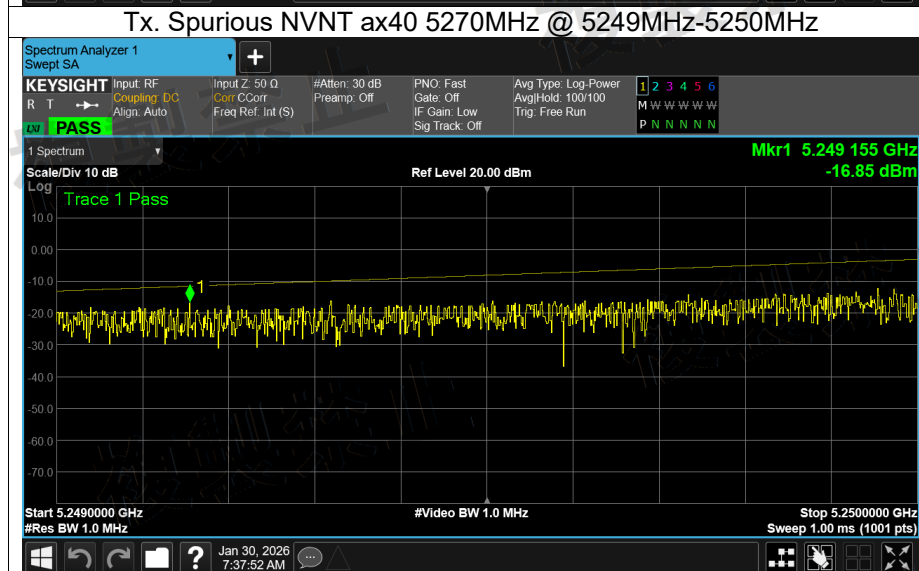




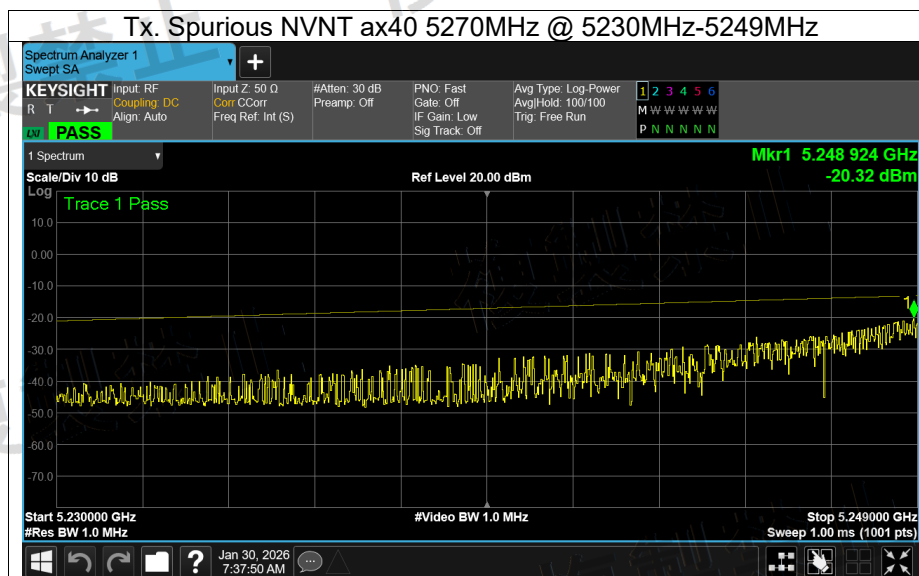




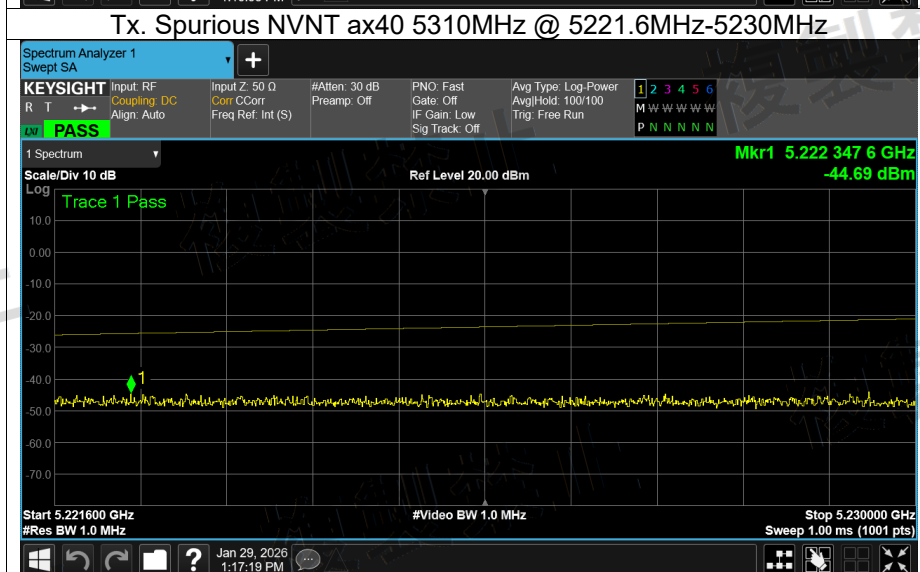




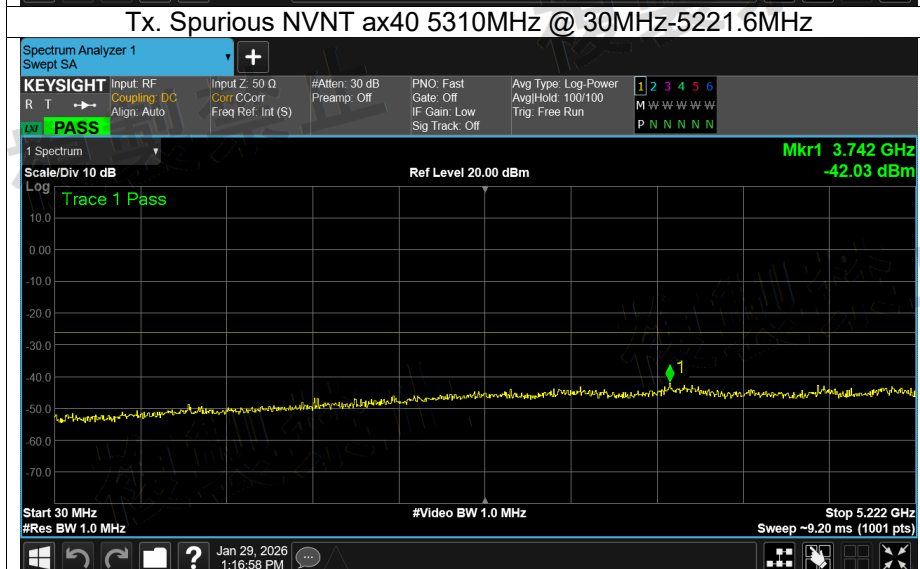


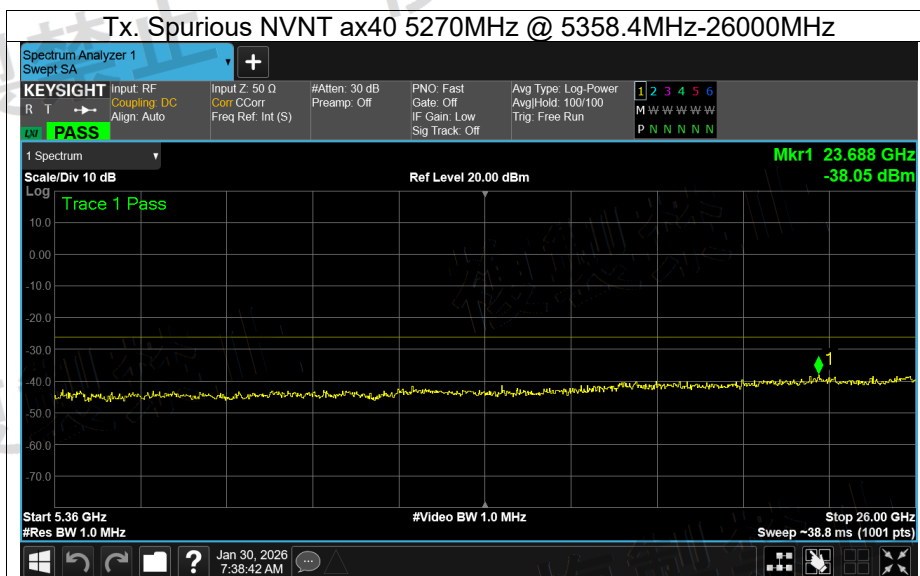


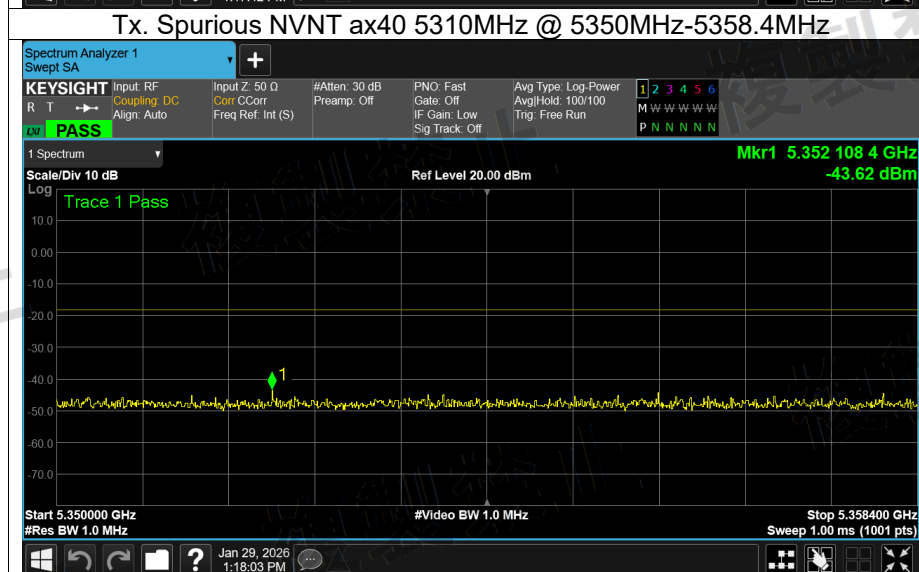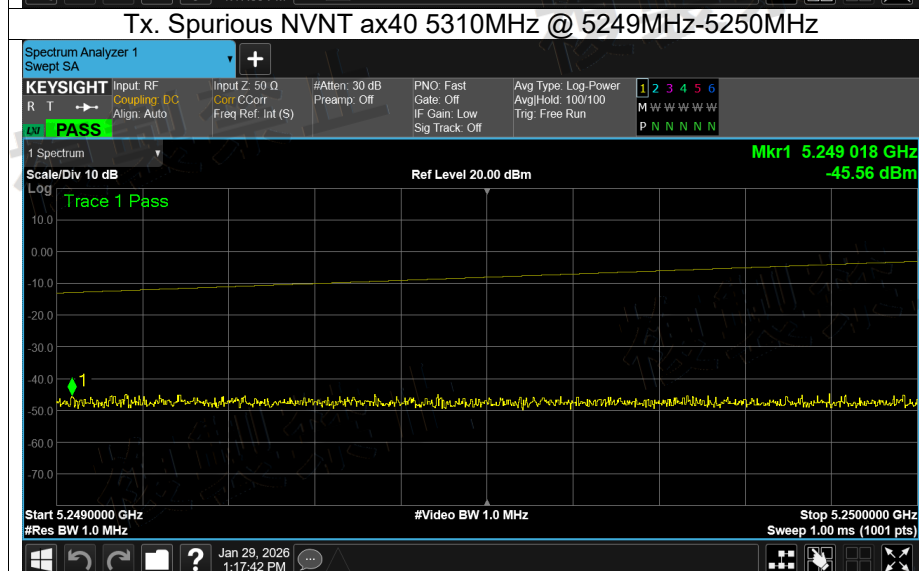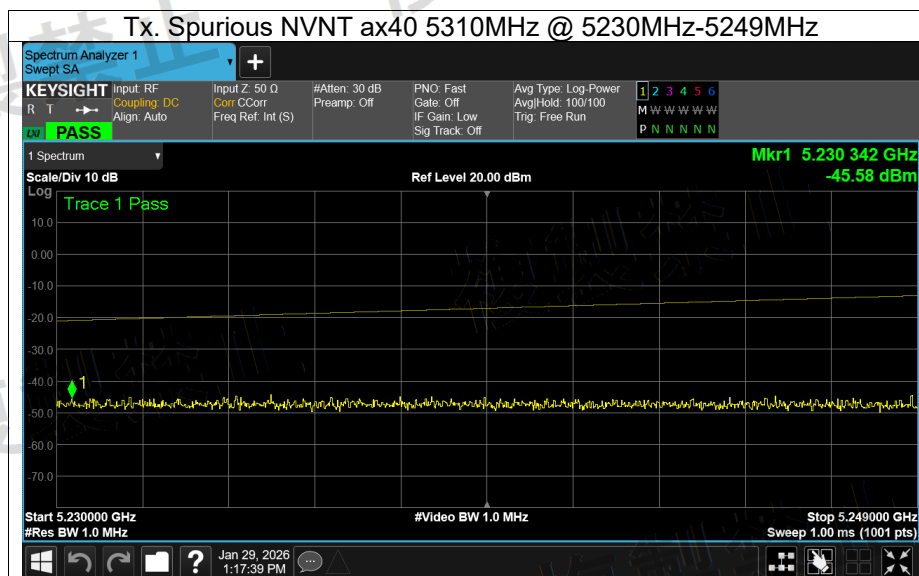

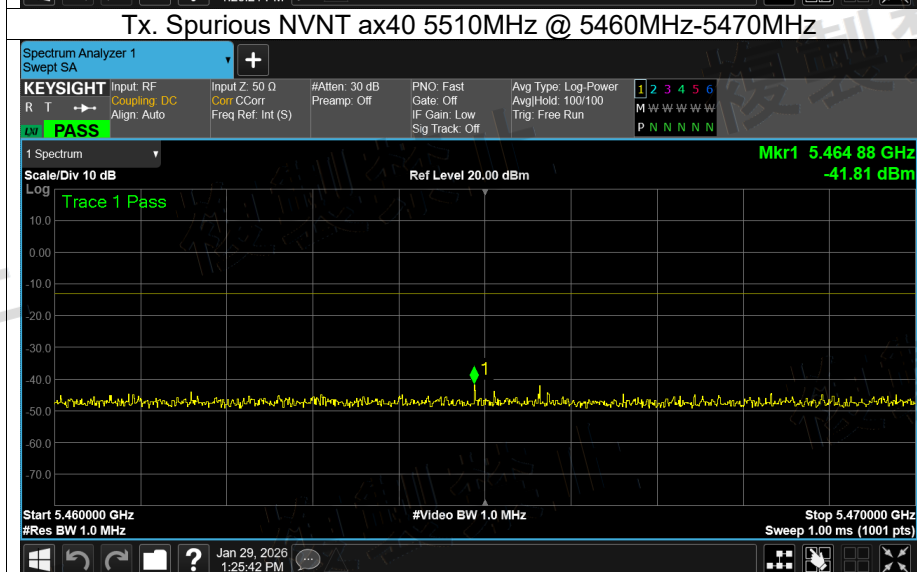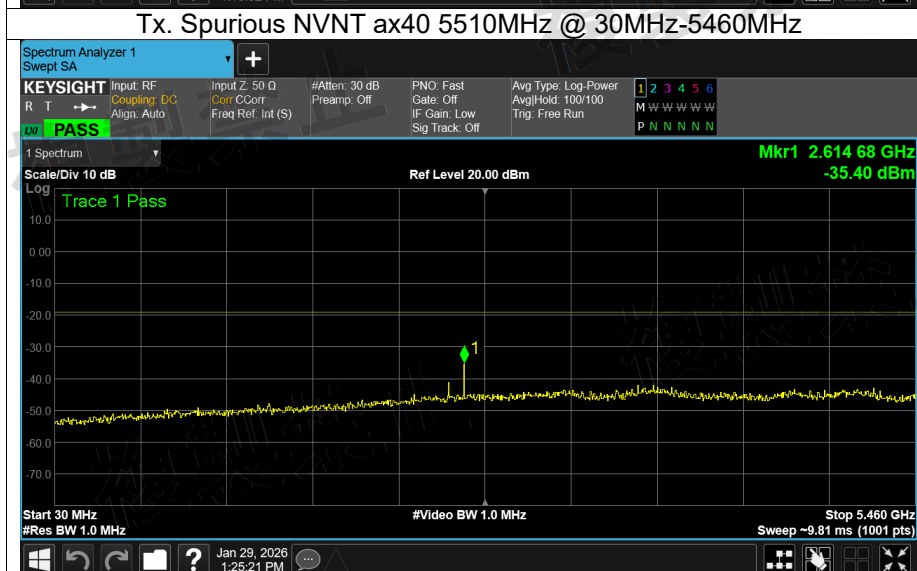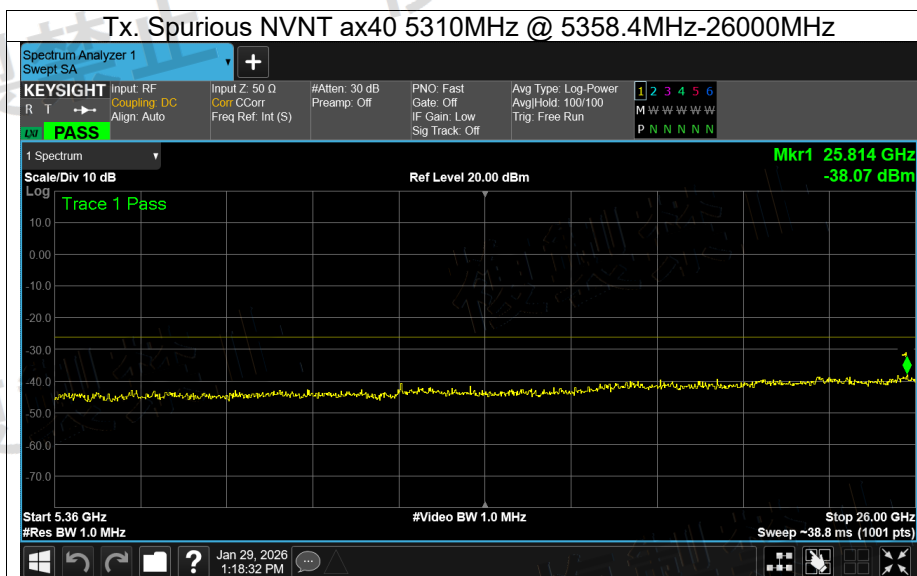

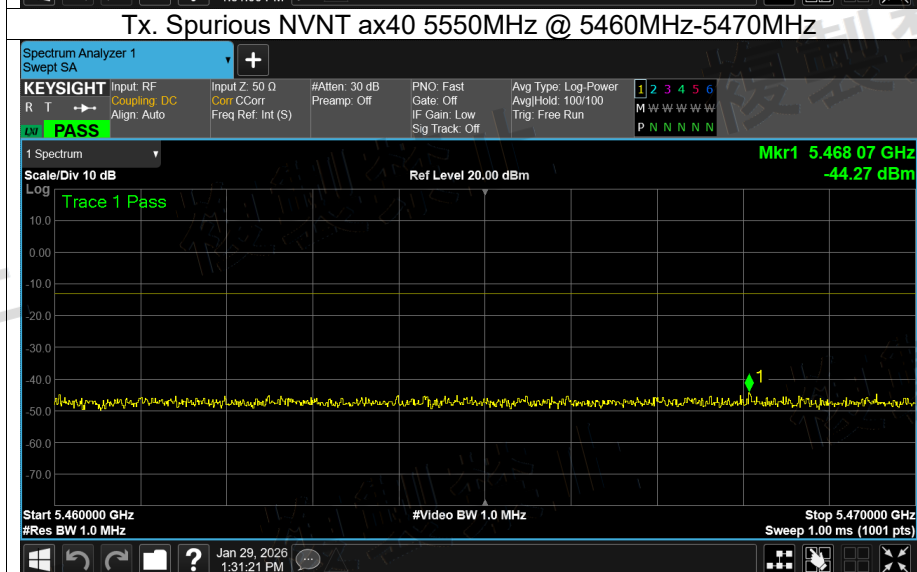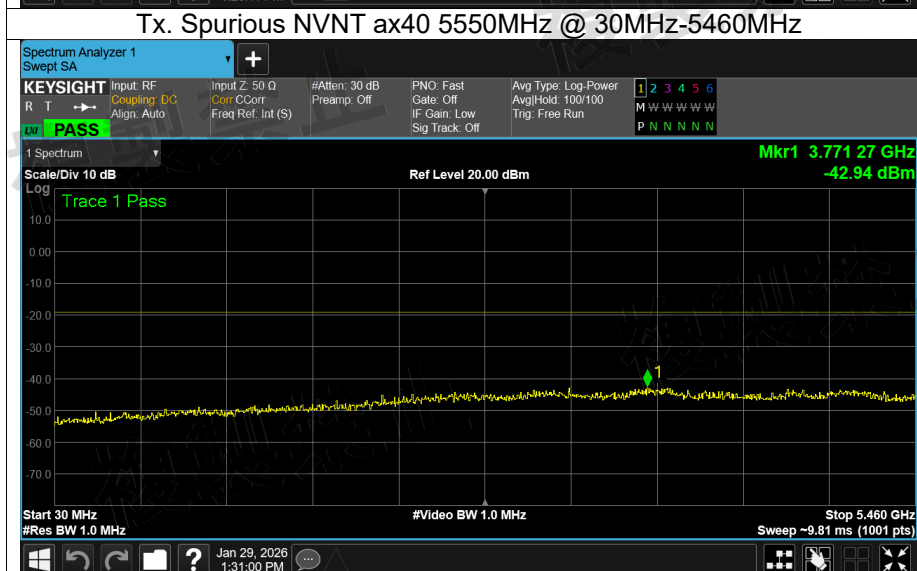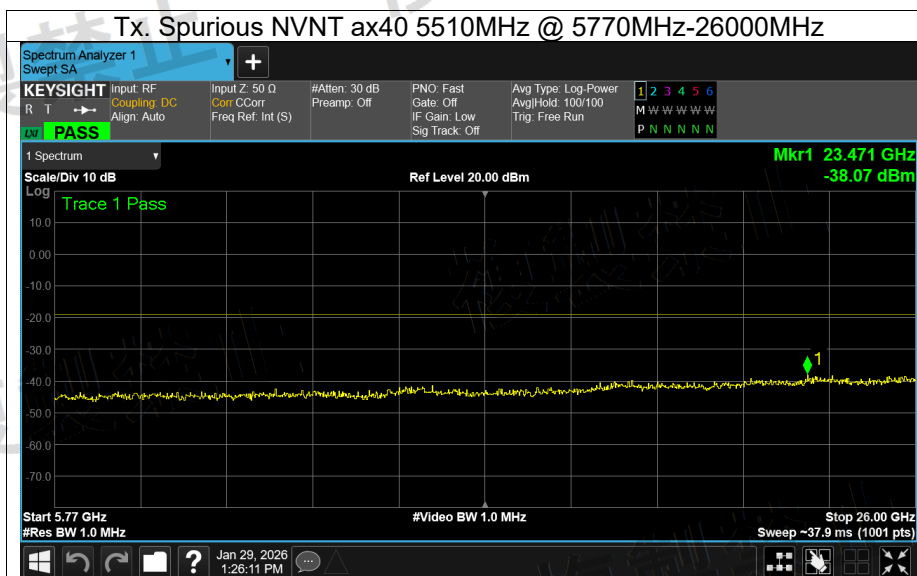

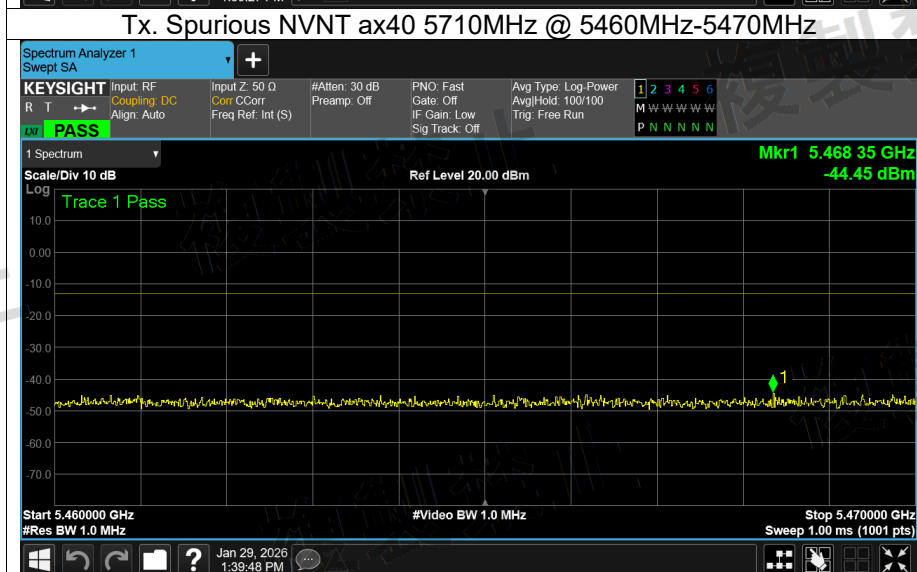
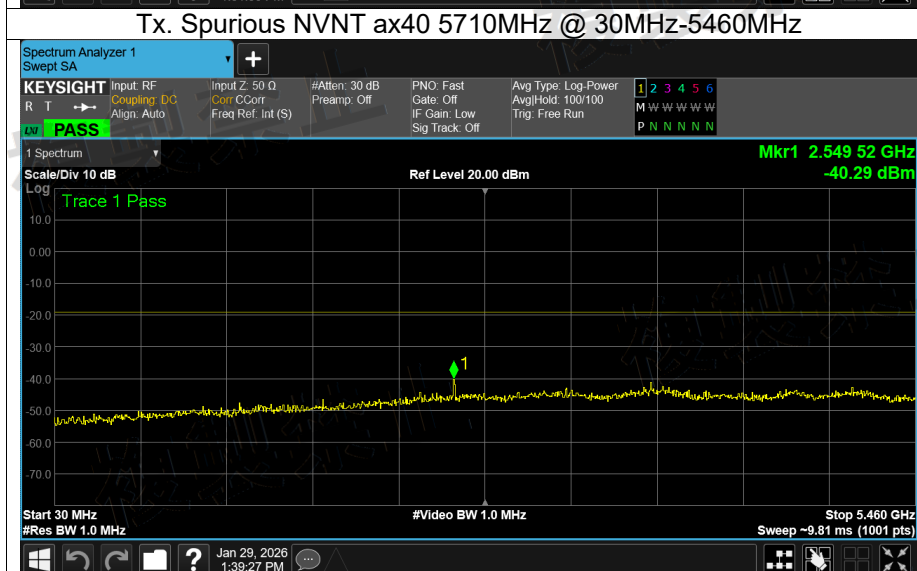
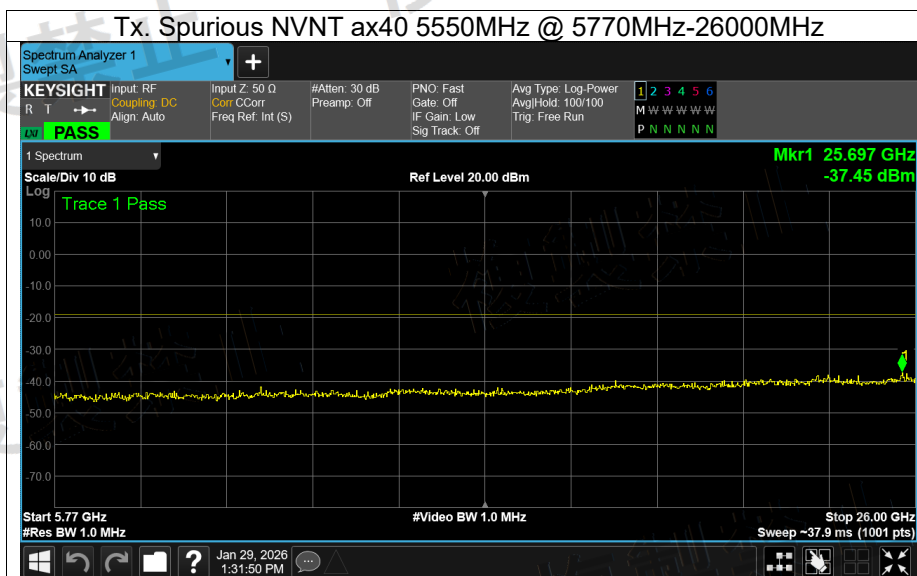




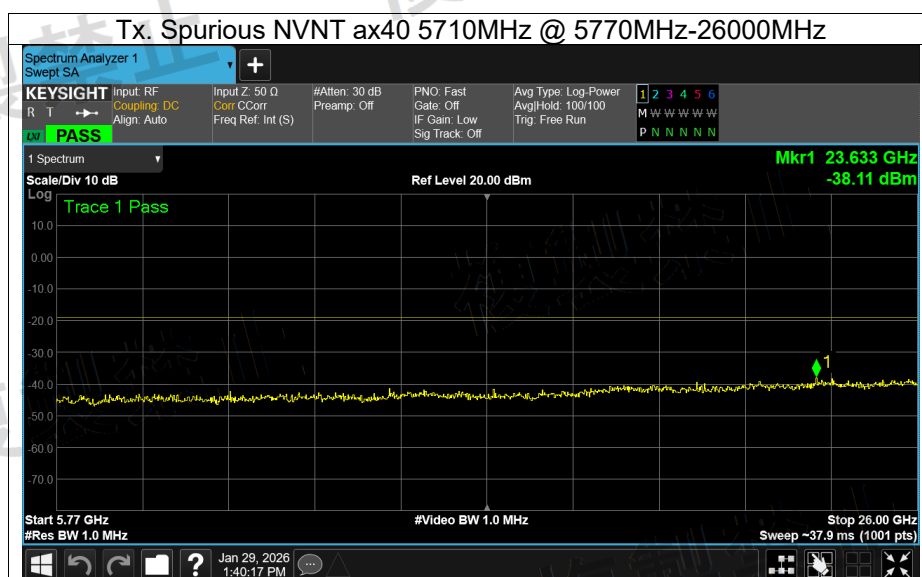










BURST LENGTH




Condition	Mode	Frequency (MHz)	Burst Length (ms)	Limit (ms)	Verdict
NVNT	a	5180	0.7	8	Pass
NVNT	a	5200	0.7	8	Pass
NVNT	a	5240	0.69	8	Pass
NVNT	a	5260	0.7	8	Pass
NVNT	a	5300	0.7	8	Pass
NVNT	a	5320	0.7	8	Pass
NVNT	a	5500	0.7	8	Pass
NVNT	a	5580	0.69	8	Pass
NVNT	a	5720	0.69	8	Pass
NVNT	n20	5180	0.65	8	Pass
NVNT	n20	5200	0.66	8	Pass
NVNT	n20	5240	0.66	8	Pass
NVNT	n20	5260	0.65	8	Pass
NVNT	n20	5300	0.66	8	Pass
NVNT	n20	5320	0.65	8	Pass
NVNT	n20	5500	0.66	8	Pass
NVNT	n20	5580	0.65	8	Pass
NVNT	n20	5720	0.65	8	Pass
NVNT	n40	5190	0.335	8	Pass
NVNT	n40	5230	0.335	8	Pass
NVNT	n40	5270	0.335	8	Pass
NVNT	n40	5310	0.335	8	Pass
NVNT	n40	5510	0.34	8	Pass
NVNT	n40	5550	0.335	8	Pass
NVNT	n40	5710	0.335	8	Pass
NVNT	ac20	5180	0.665	8	Pass
NVNT	ac20	5200	0.665	8	Pass
NVNT	ac20	5240	0.665	8	Pass
NVNT	ac20	5260	0.665	8	Pass
NVNT	ac20	5300	0.665	8	Pass
NVNT	ac20	5320	0.665	8	Pass
NVNT	ac20	5500	0.665	8	Pass
NVNT	ac20	5580	0.665	8	Pass
NVNT	ac20	5720	0.665	8	Pass
NVNT	ac40	5190	0.34	8	Pass
NVNT	ac40	5230	0.34	8	Pass
NVNT	ac40	5270	0.34	8	Pass
NVNT	ac40	5310	0.34	8	Pass
NVNT	ac40	5510	0.34	8	Pass
NVNT	ac40	5550	0.34	8	Pass
NVNT	ac40	5710	0.34	8	Pass
NVNT	ax20	5180	0.53	8	Pass
NVNT	ax20	5200	0.53	8	Pass
NVNT	ax20	5240	0.525	8	Pass
NVNT	ax20	5260	0.525	8	Pass
NVNT	ax20	5300	0.53	8	Pass
NVNT	ax20	5320	0.53	8	Pass
NVNT	ax20	5500	0.53	8	Pass
NVNT	ax20	5580	0.525	8	Pass
NVNT	ax20	5720	0.53	8	Pass
NVNT	ax40	5190	0.295	8	Pass
NVNT	ax40	5230	0.3	8	Pass
NVNT	ax40	5270	0.3	8	Pass
NVNT	ax40	5310	0.3	8	Pass
NVNT	ax40	5510	0.295	8	Pass
NVNT	ax40	5550	0.3	8	Pass
NVNT	ax40	5710	0.3	8	Pass

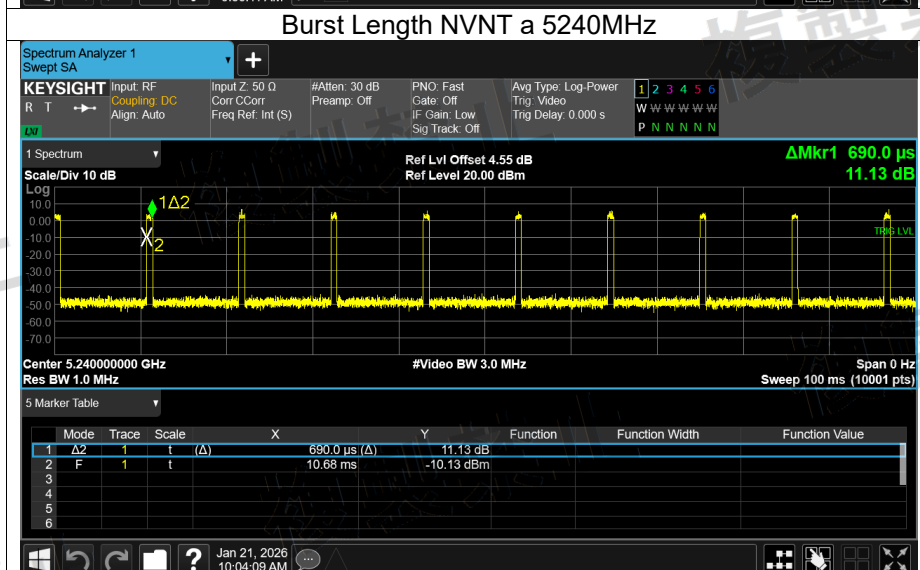
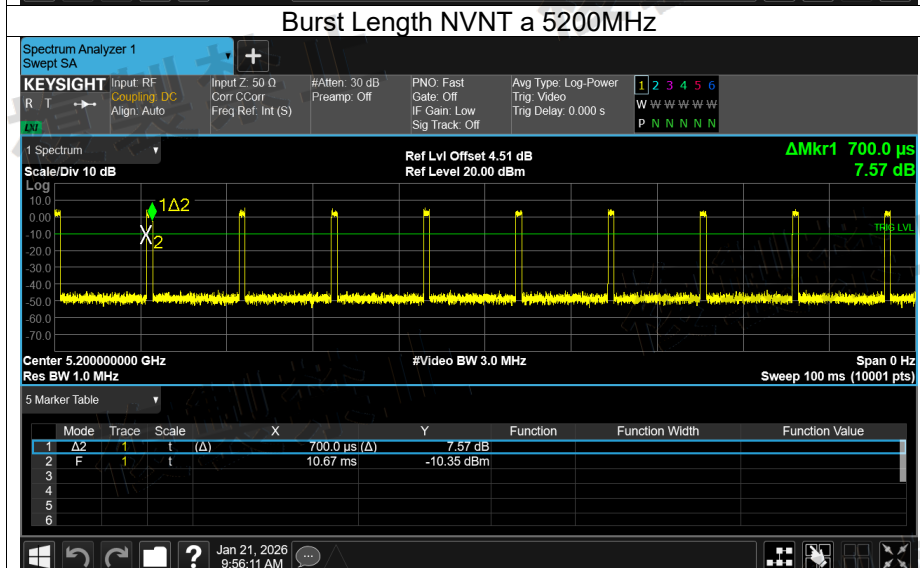
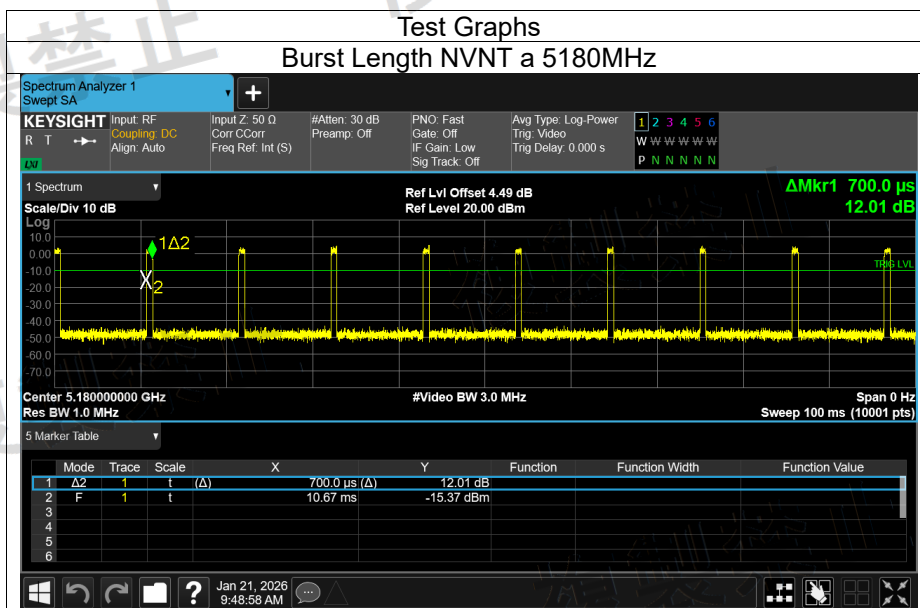


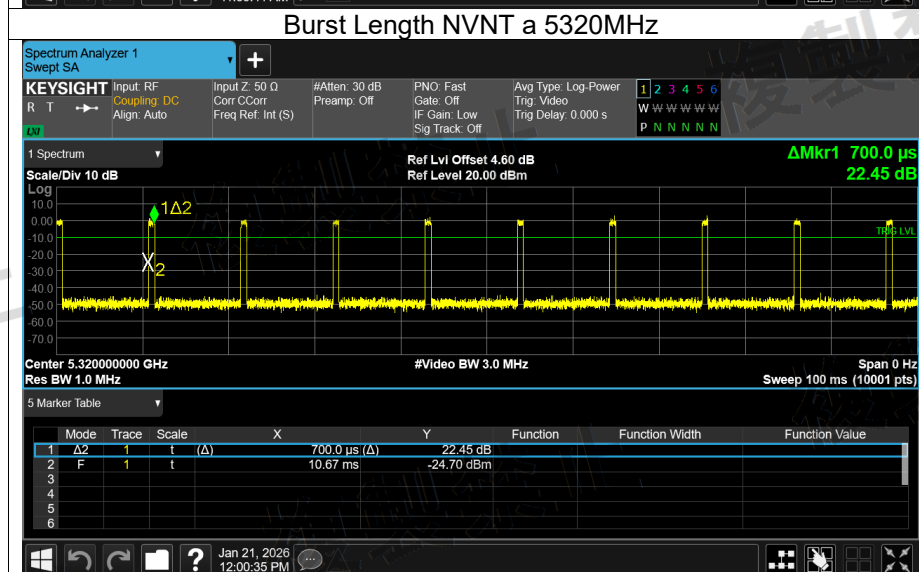
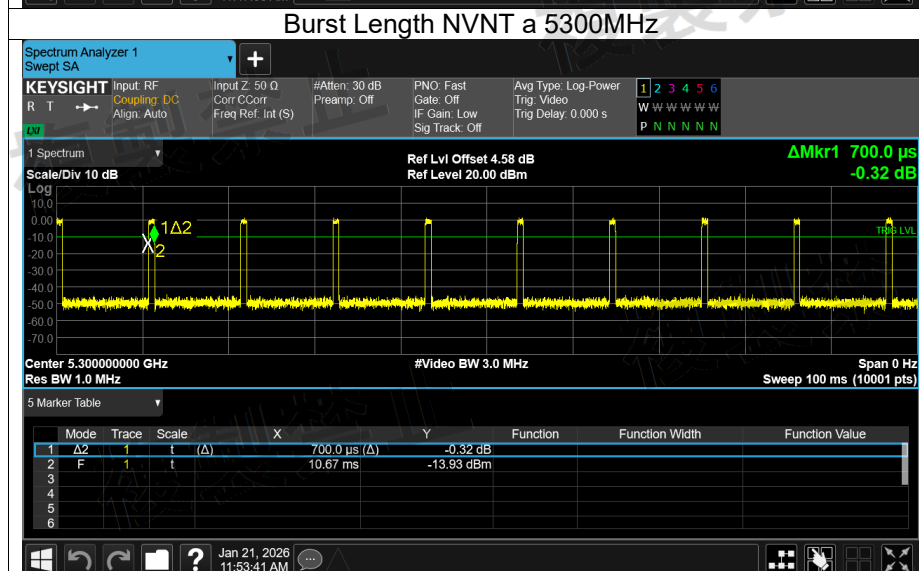
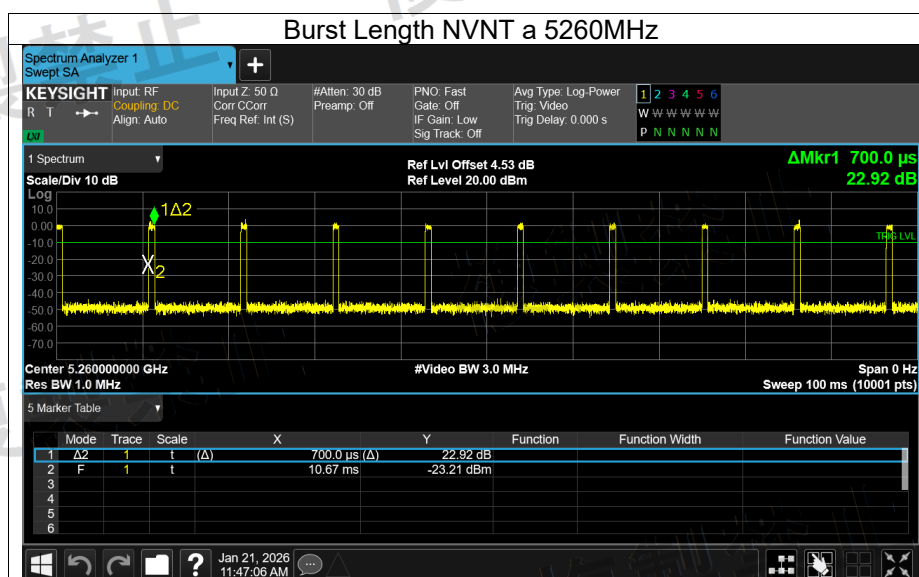


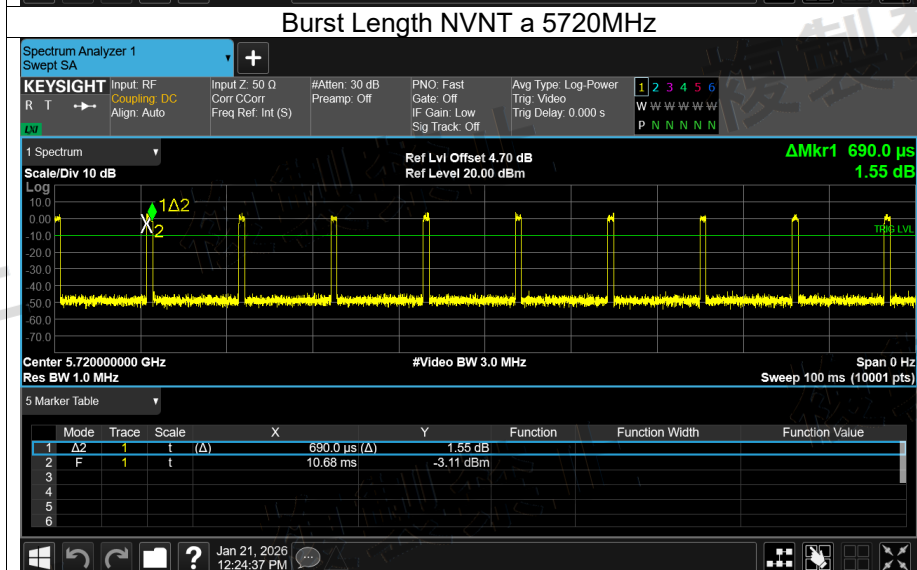
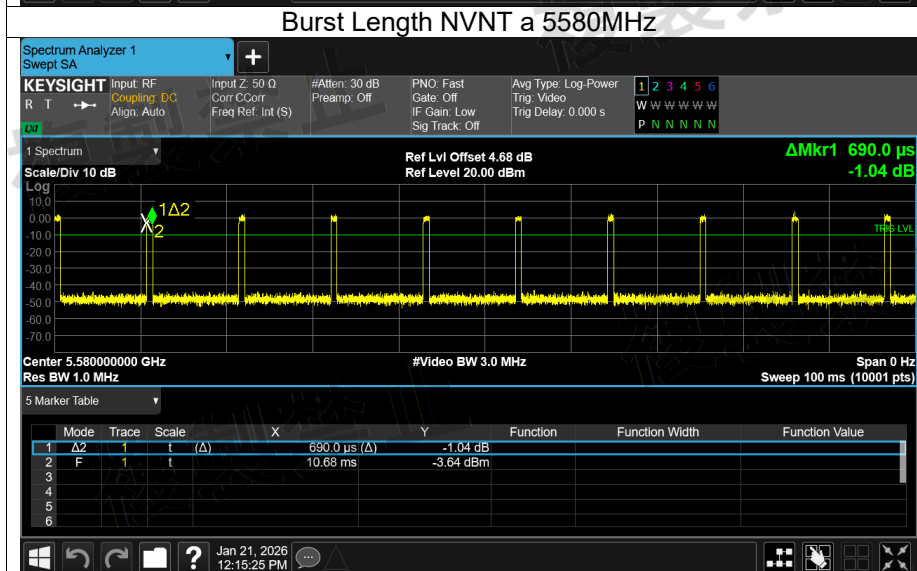
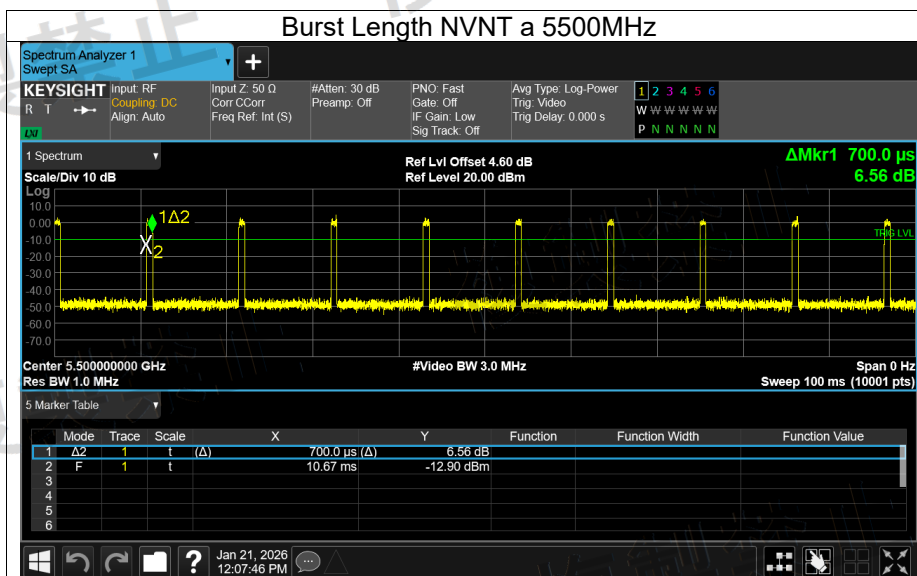


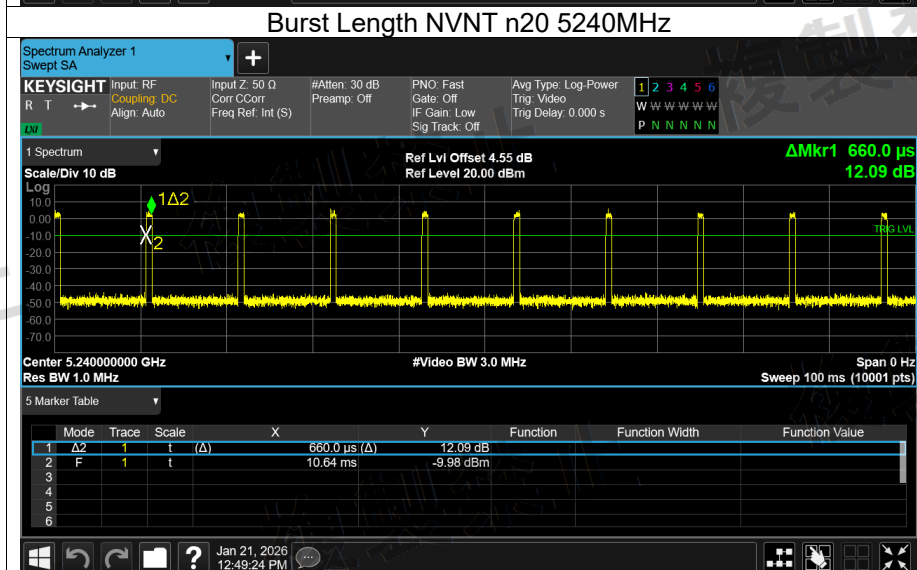
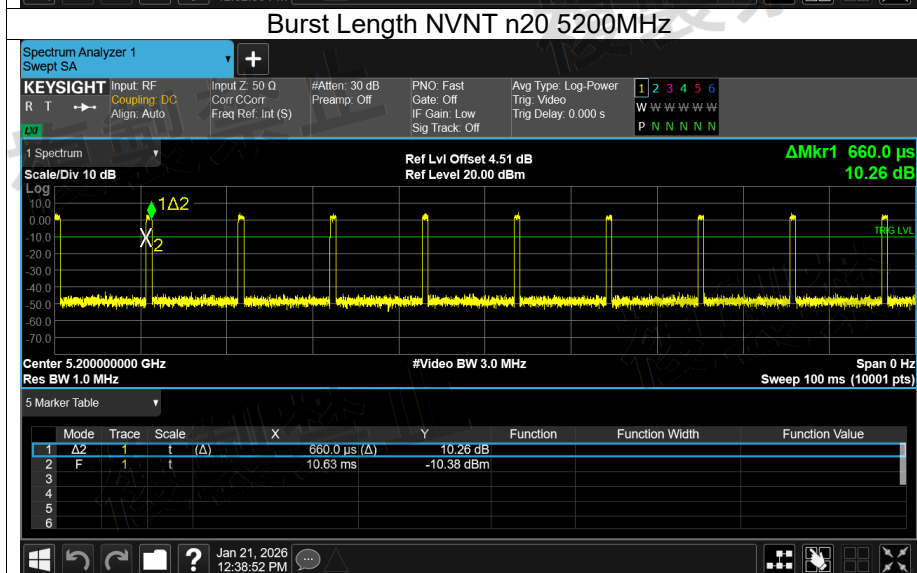
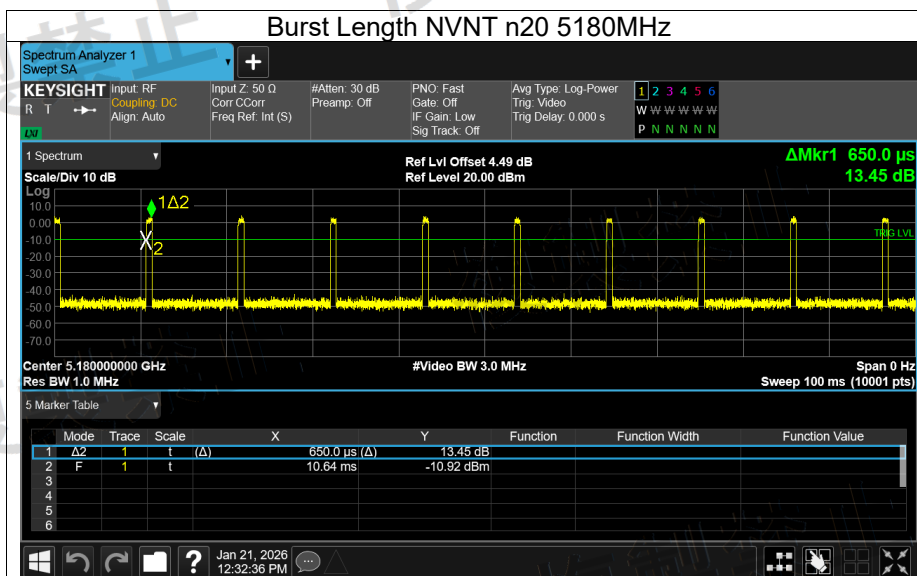


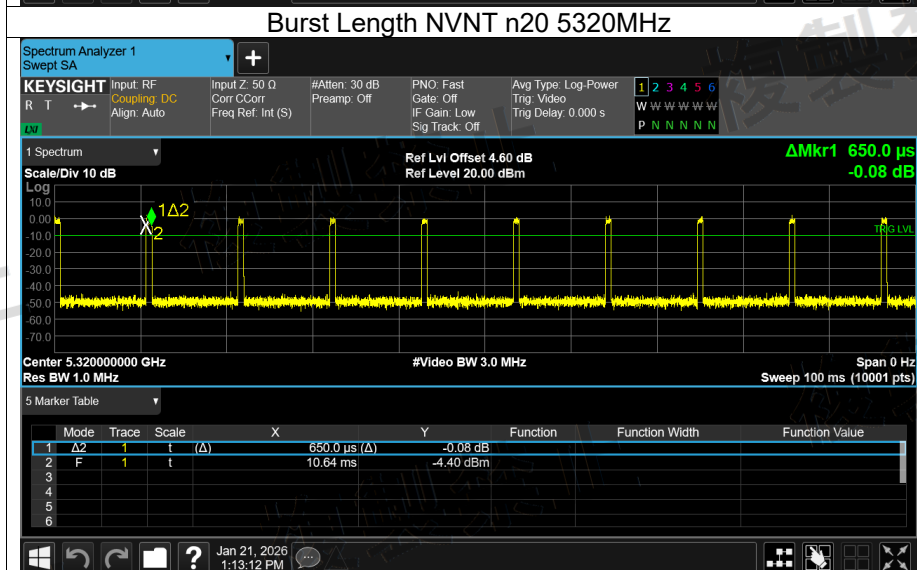
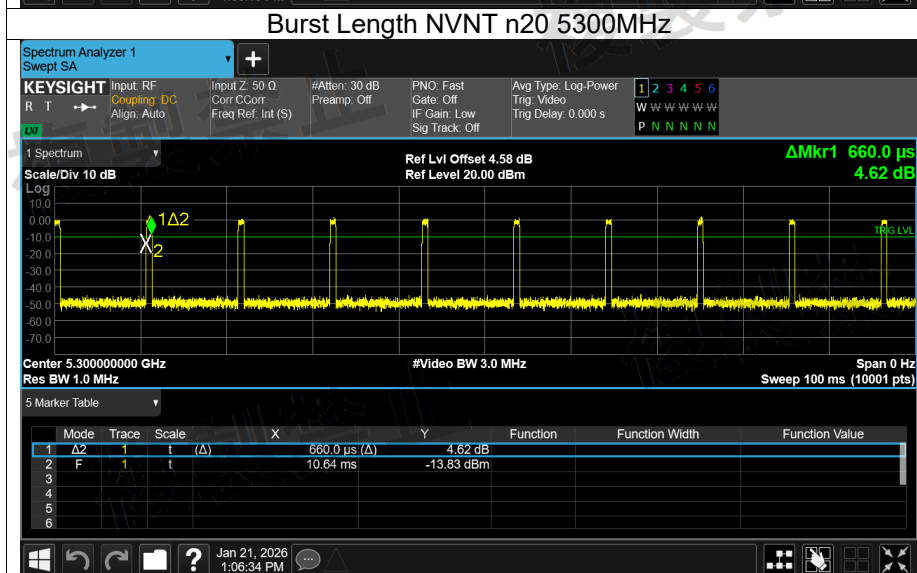
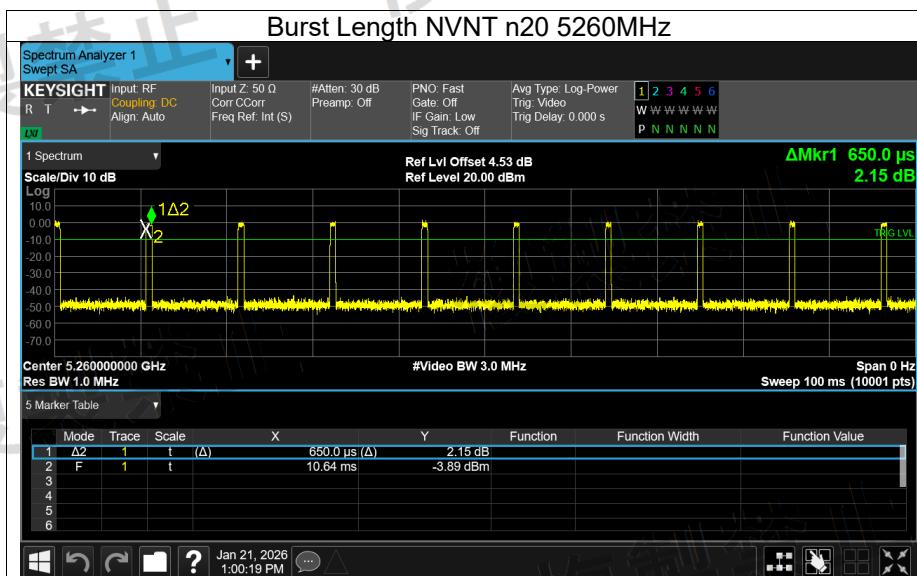


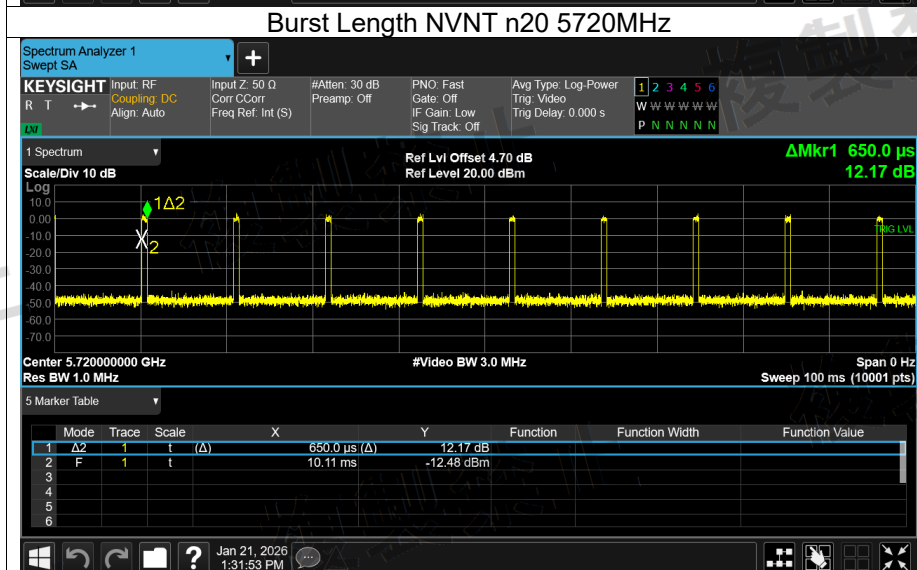
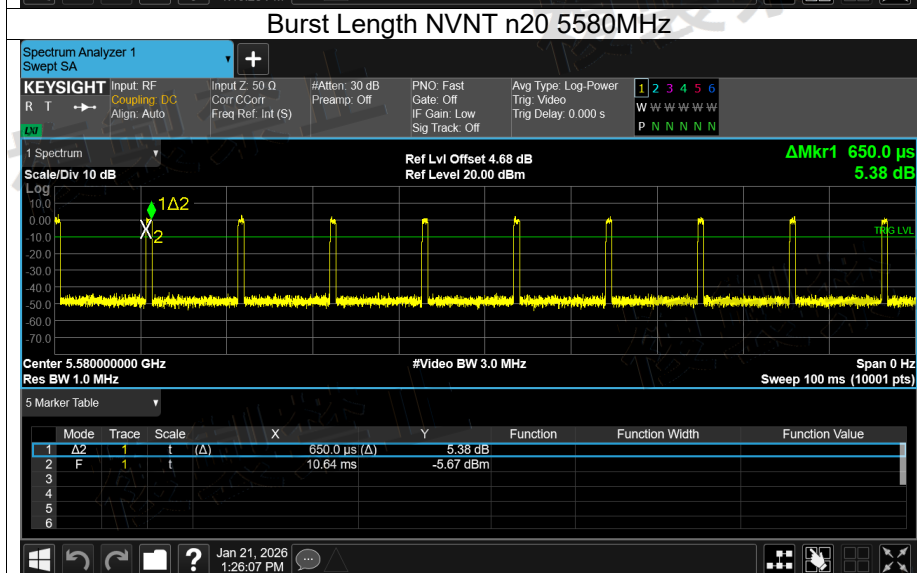
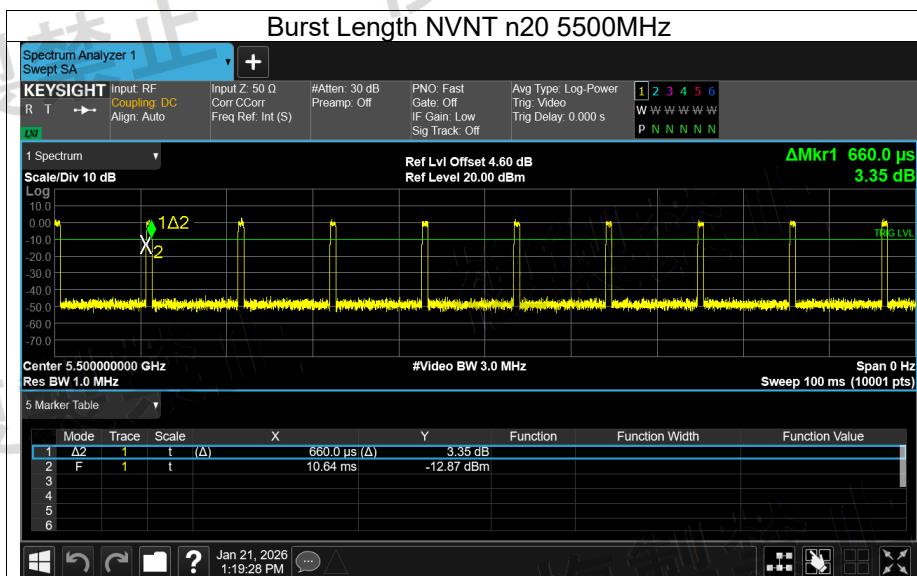


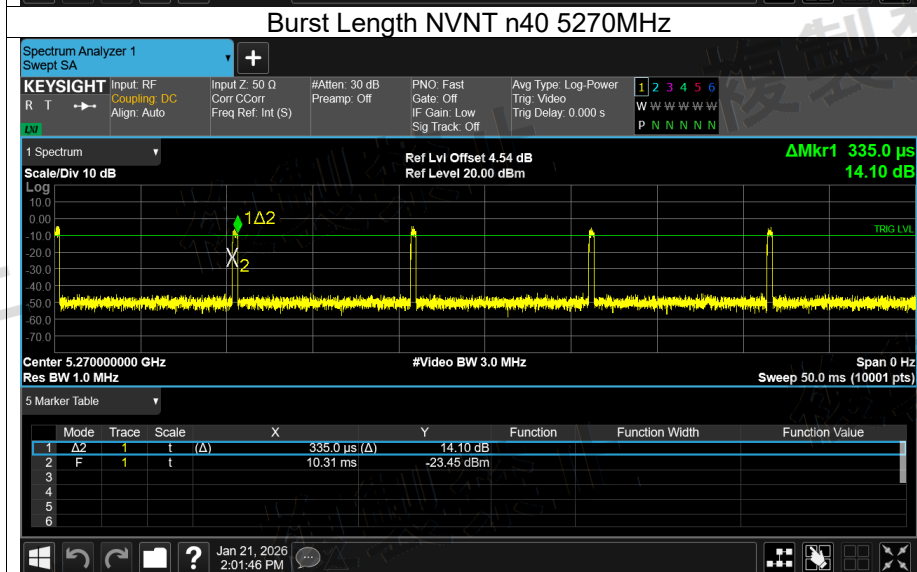
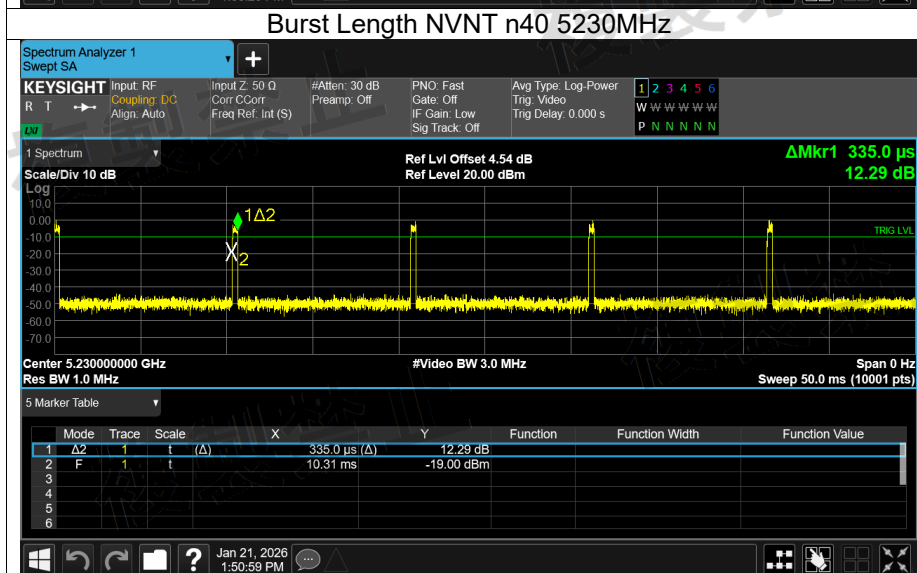
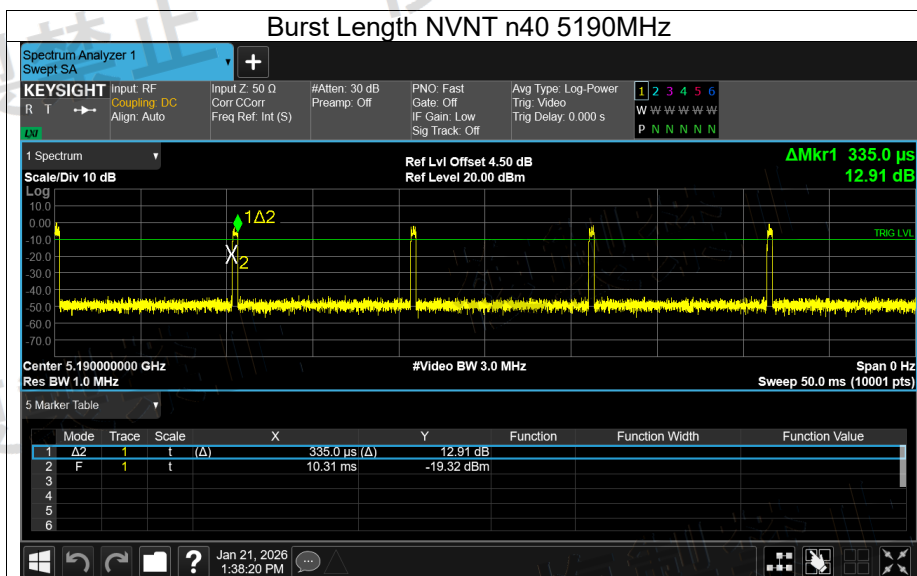


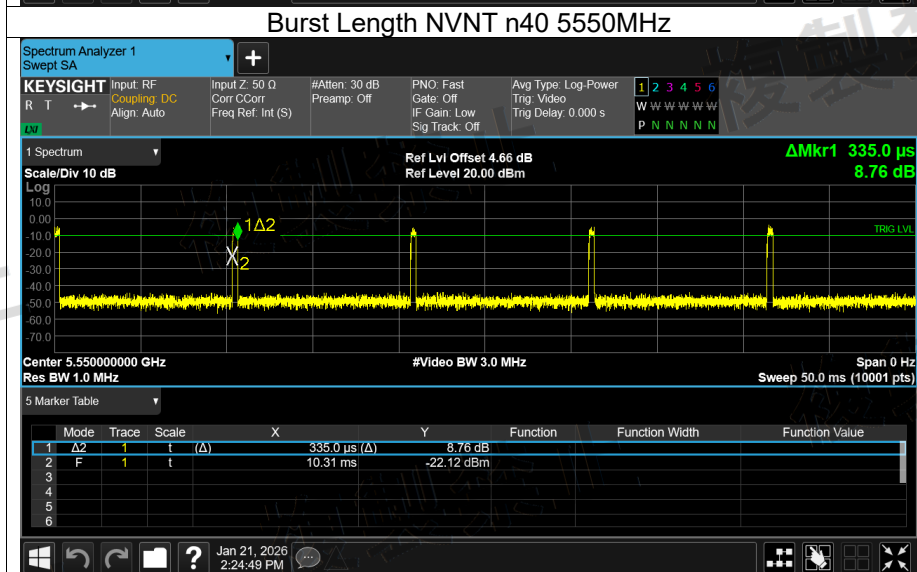
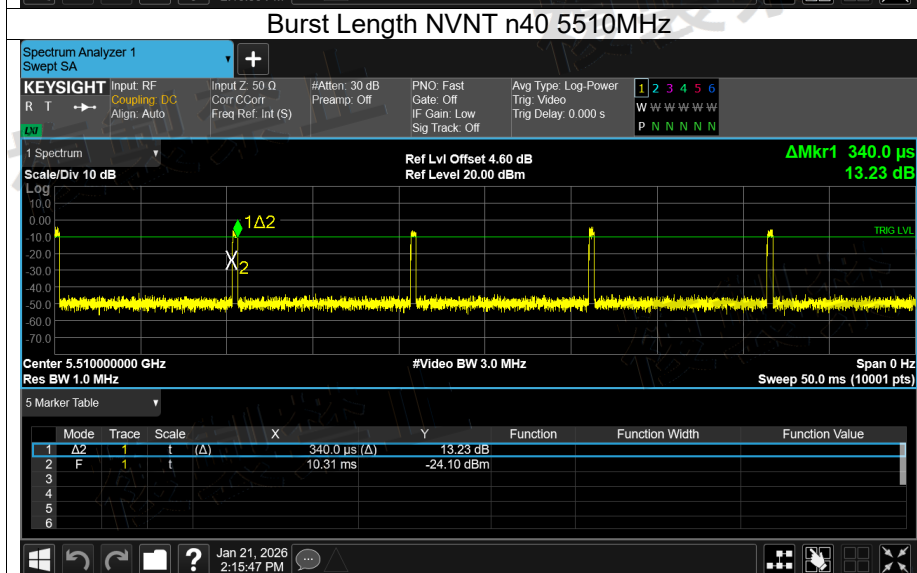
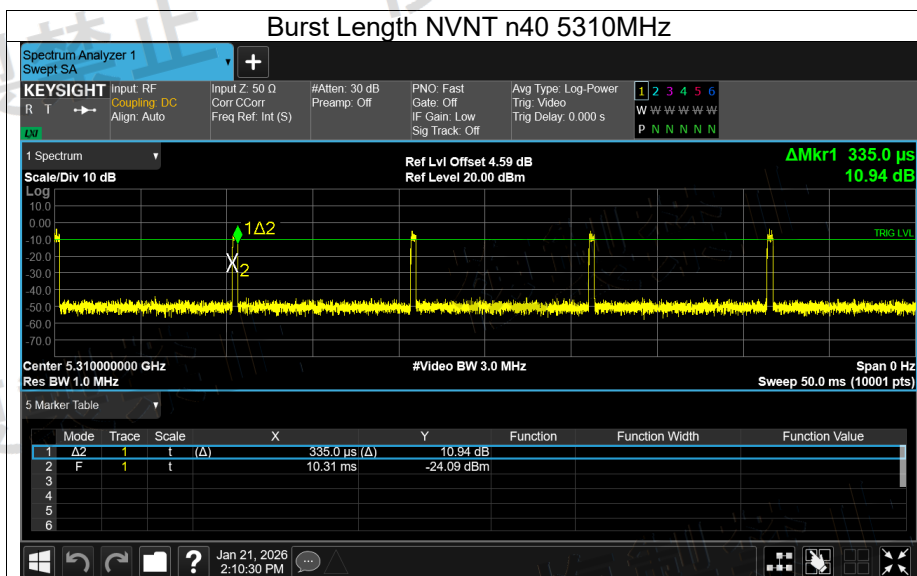


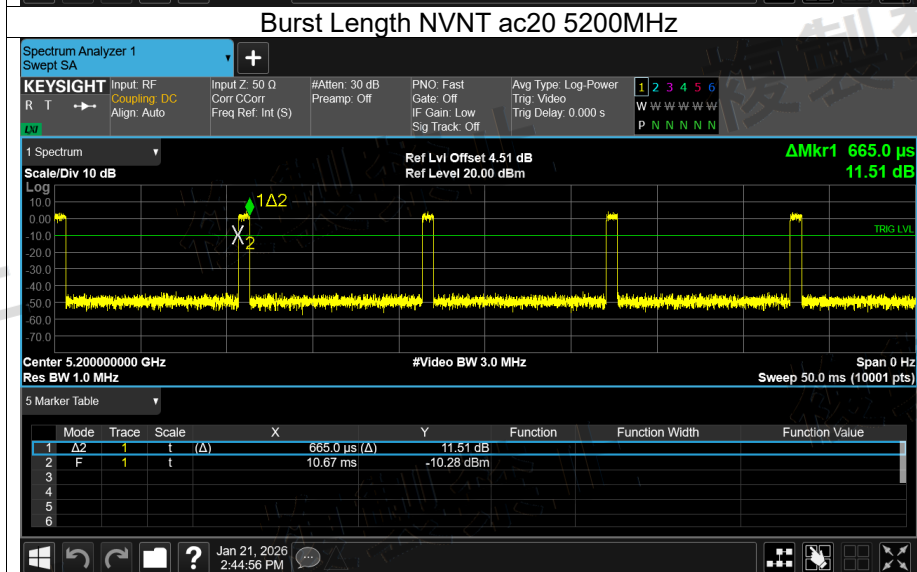
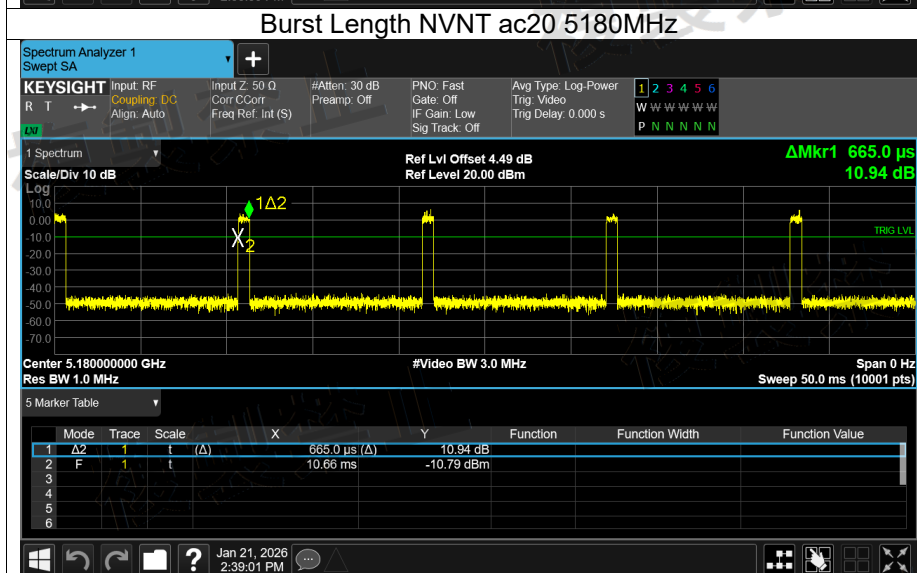
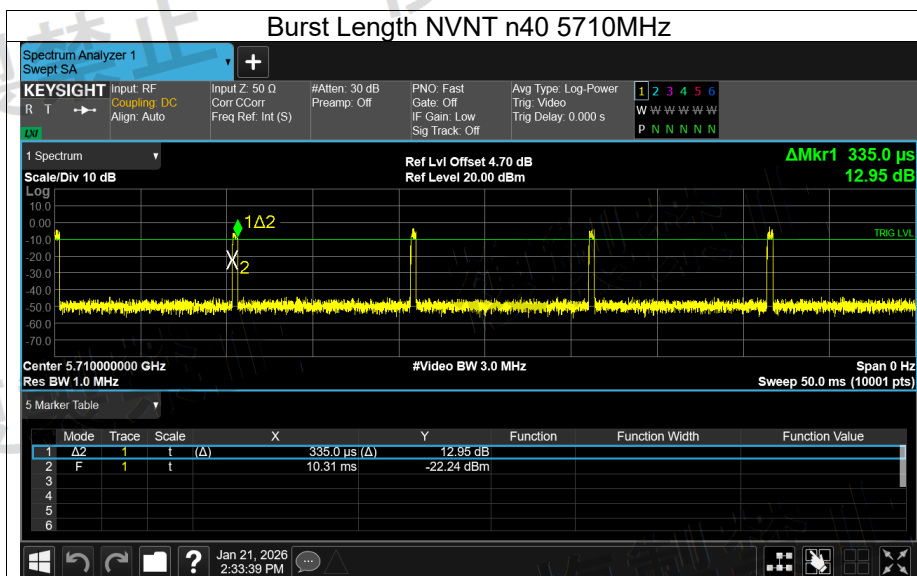


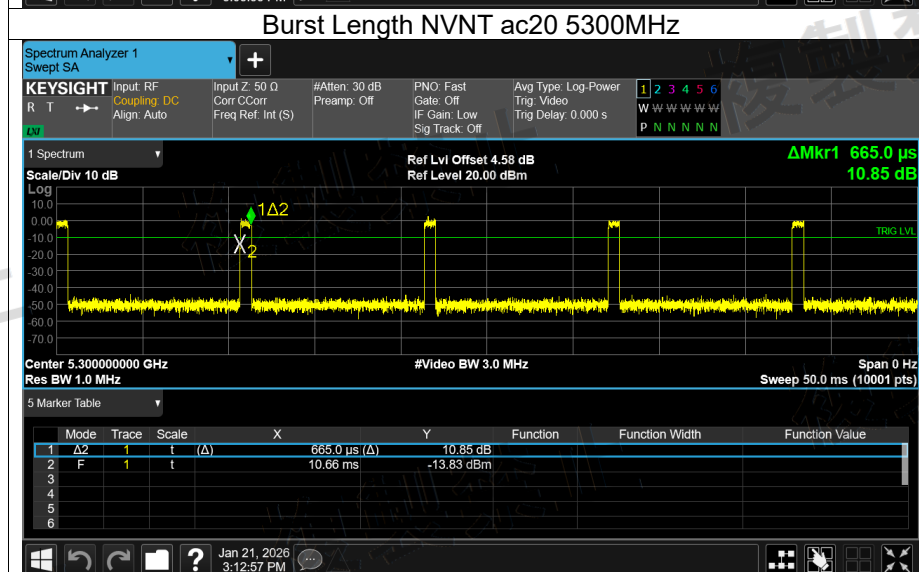
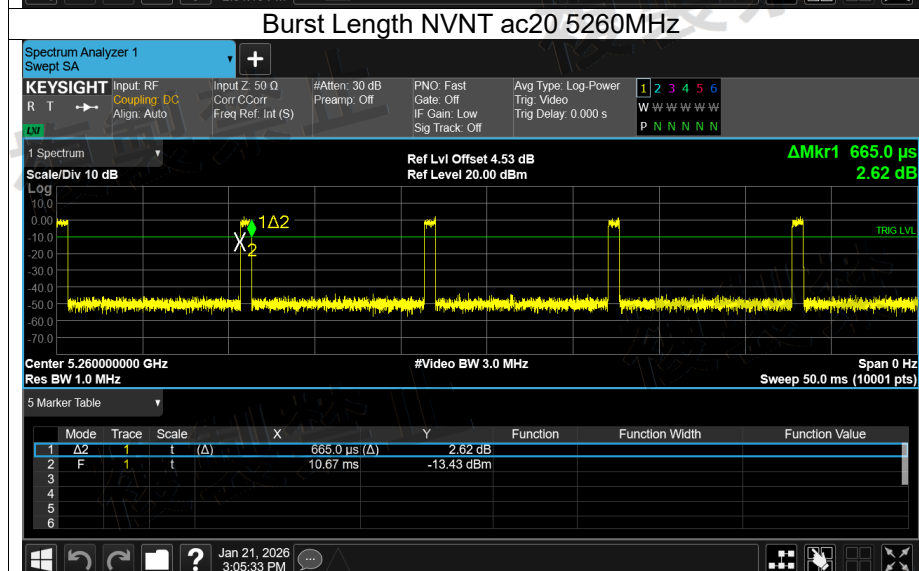
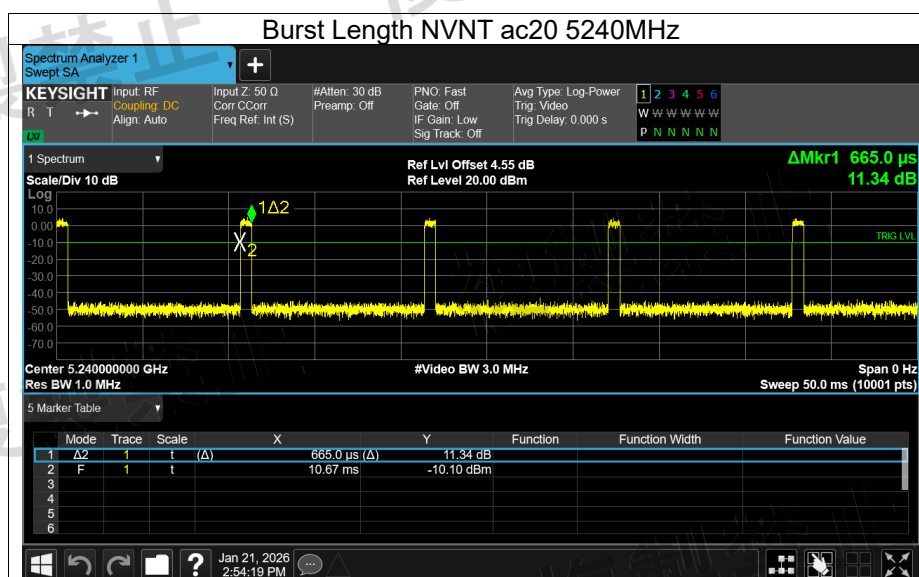


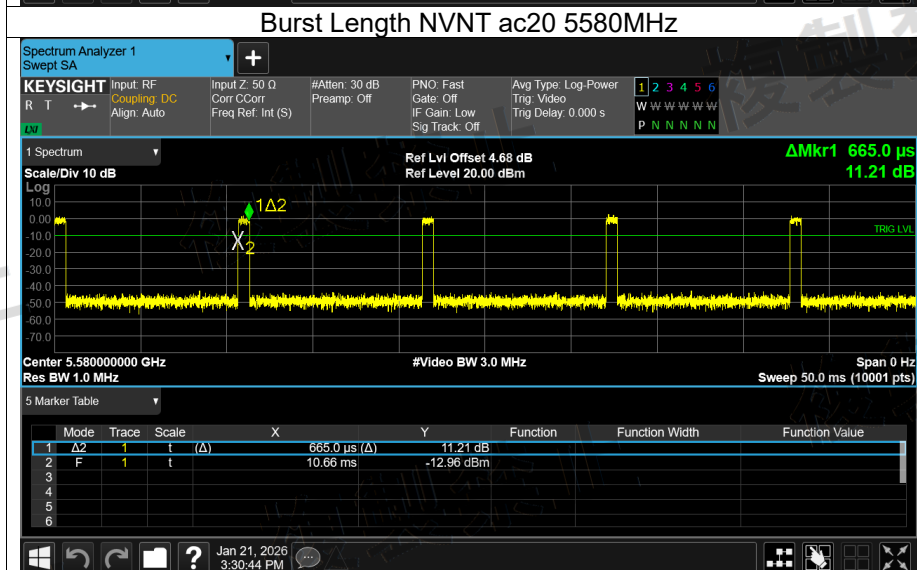
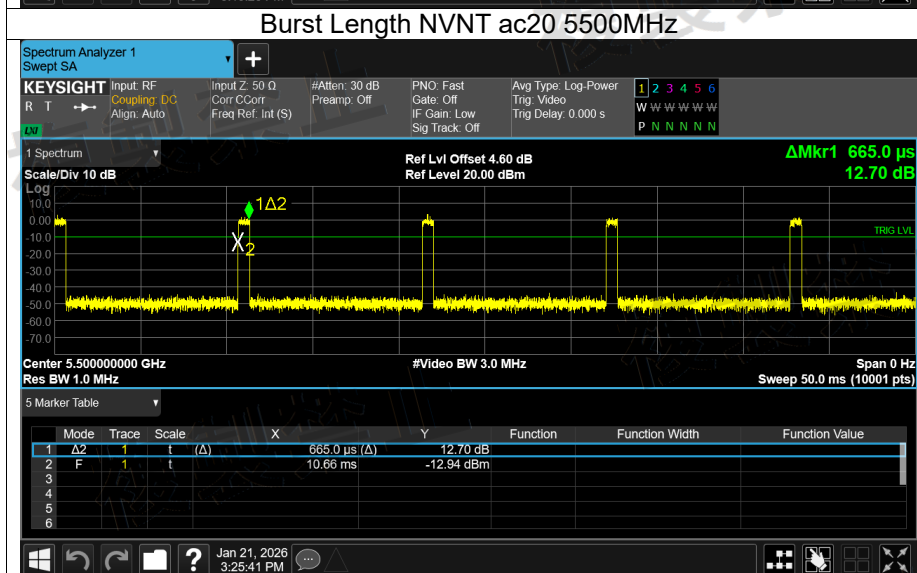
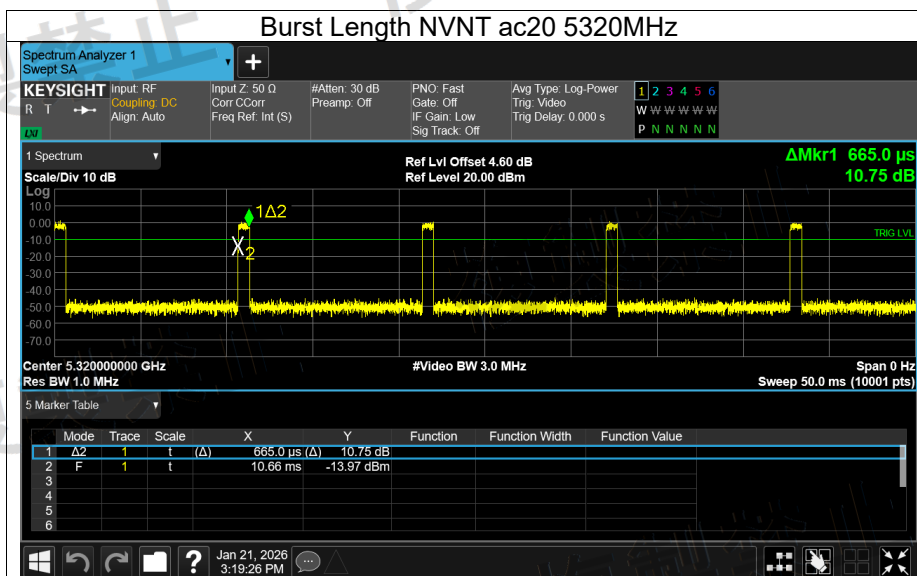


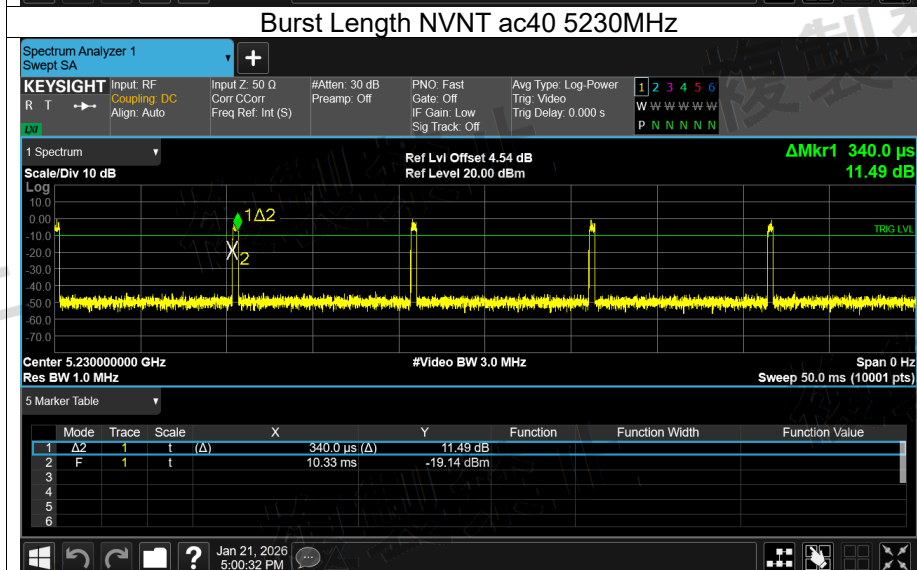
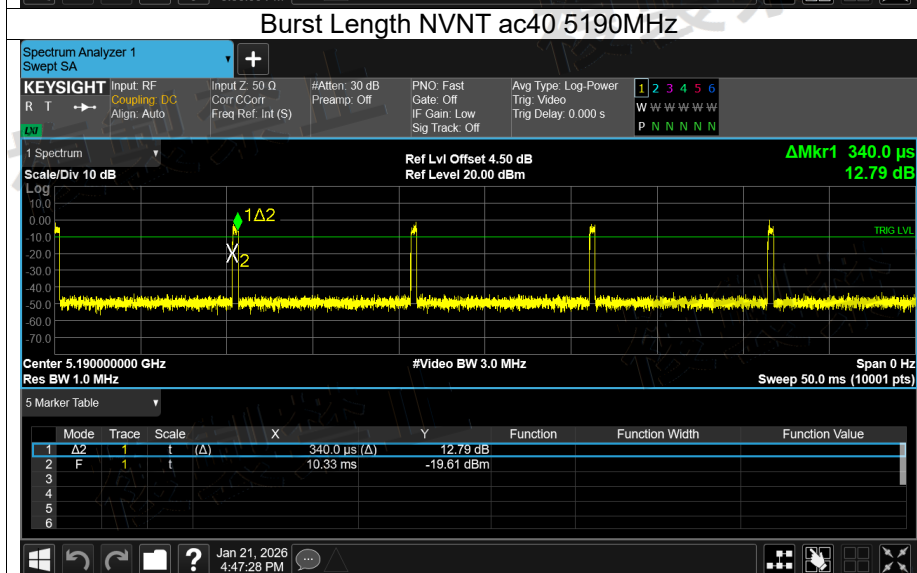
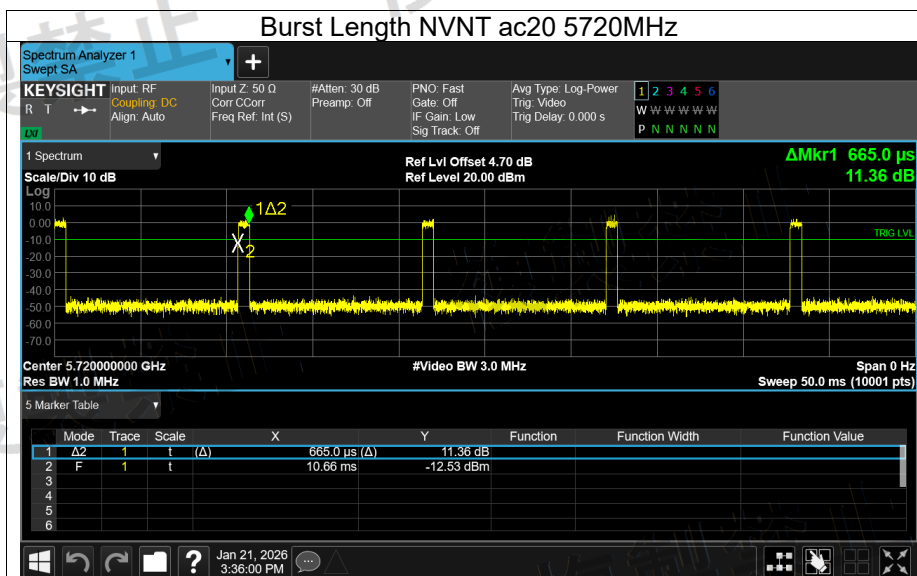


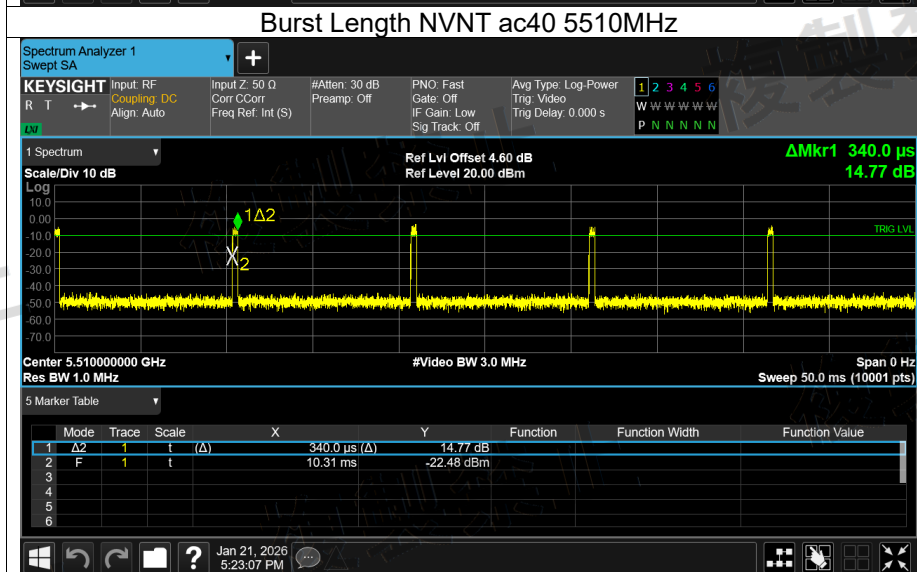
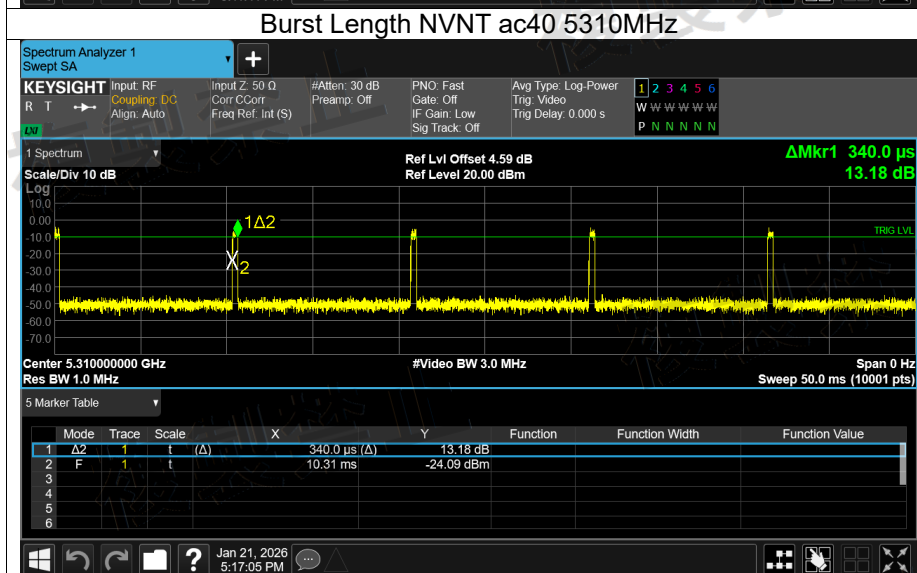
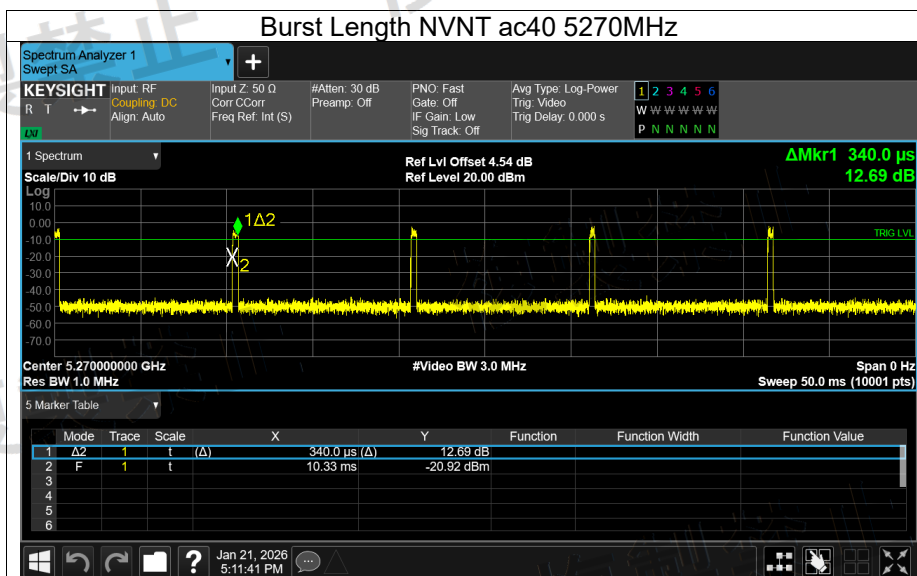


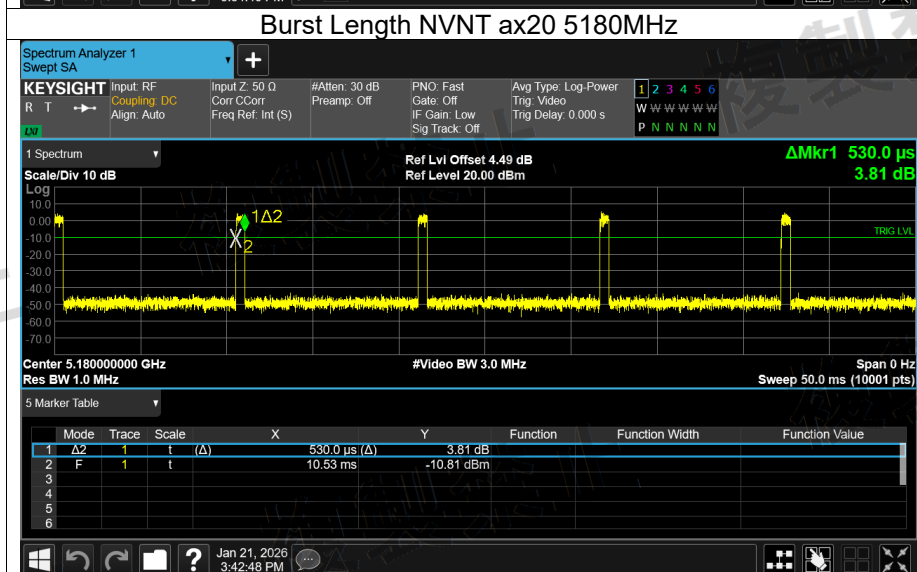
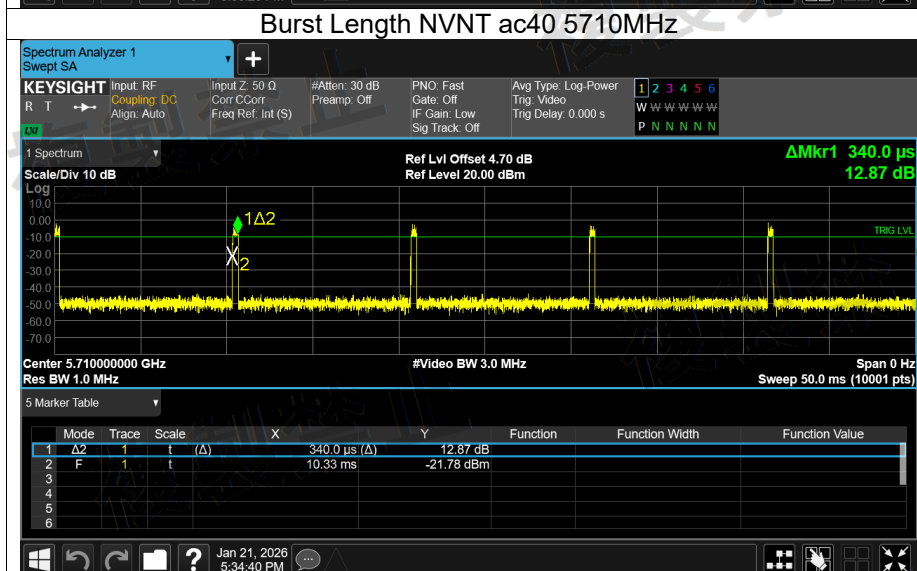
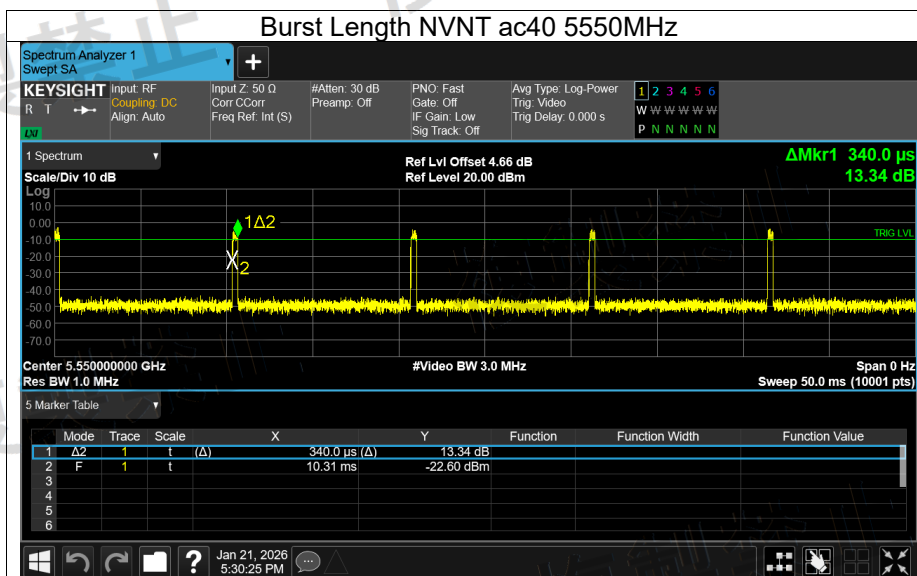


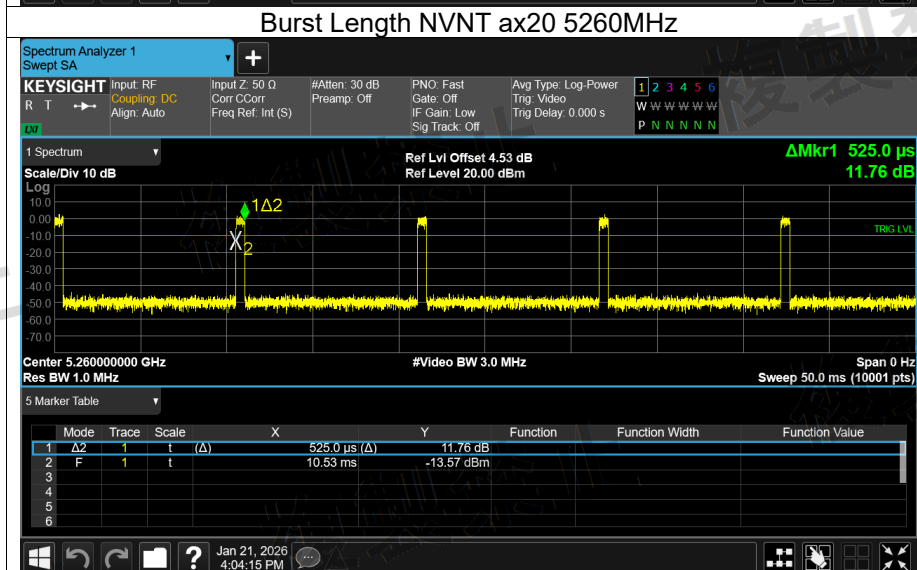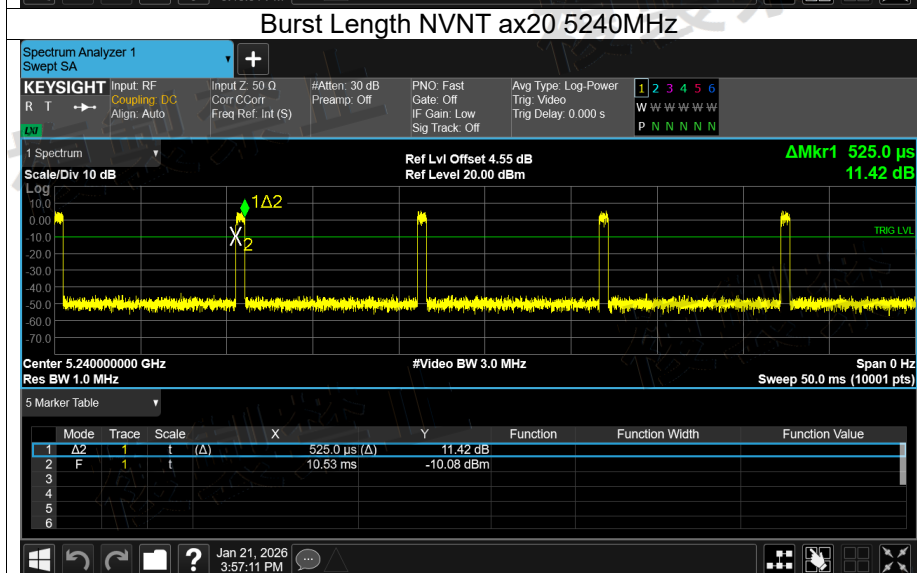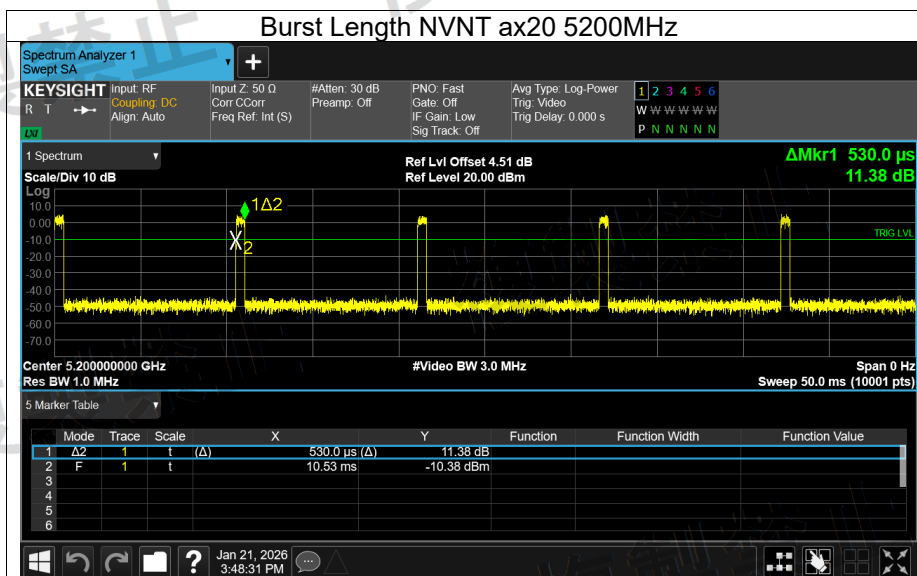

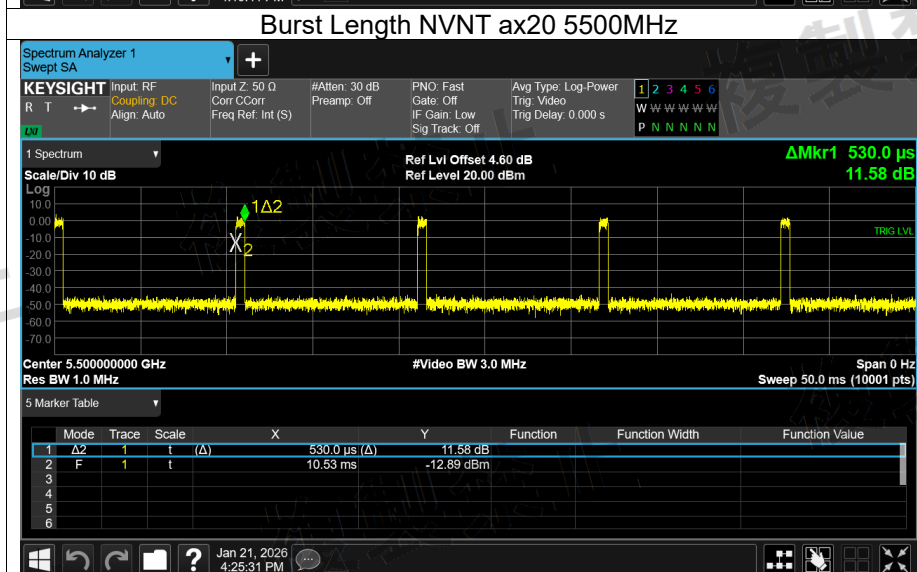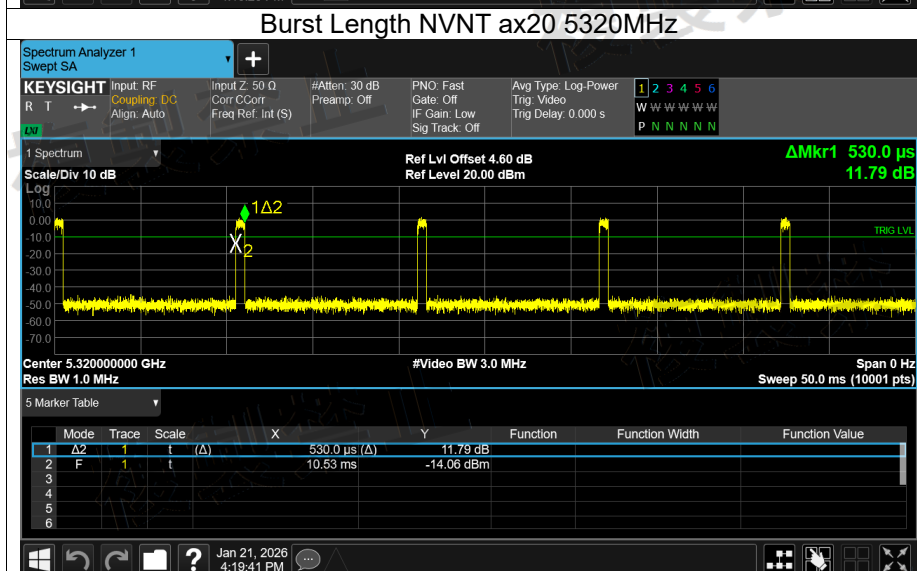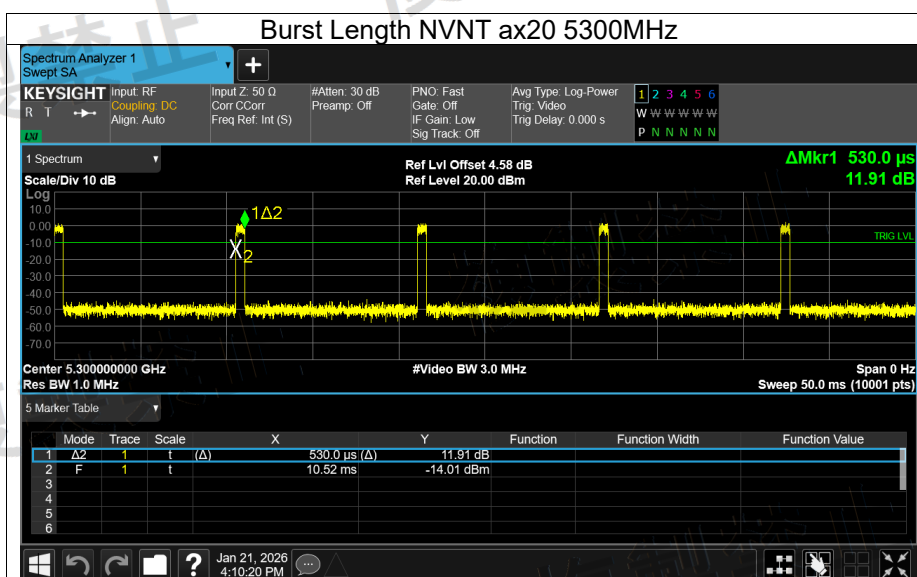

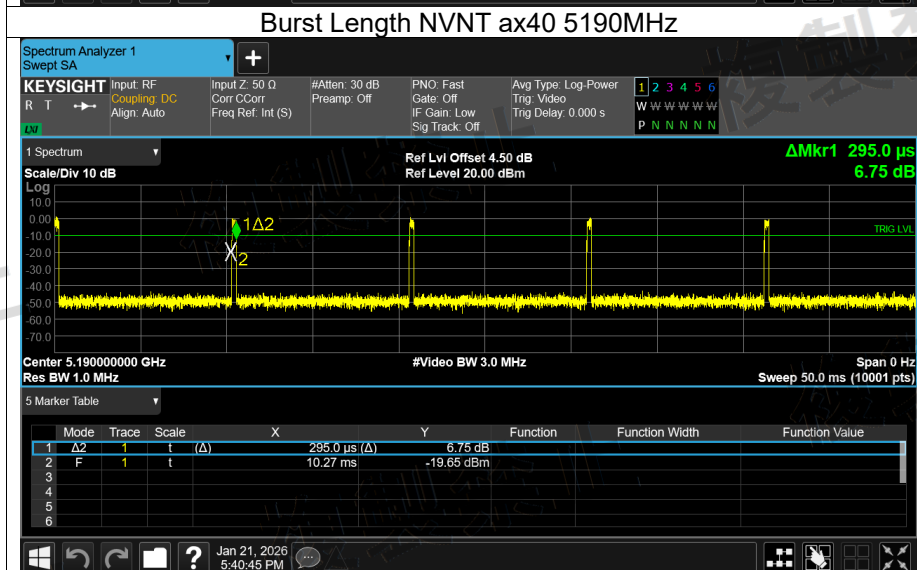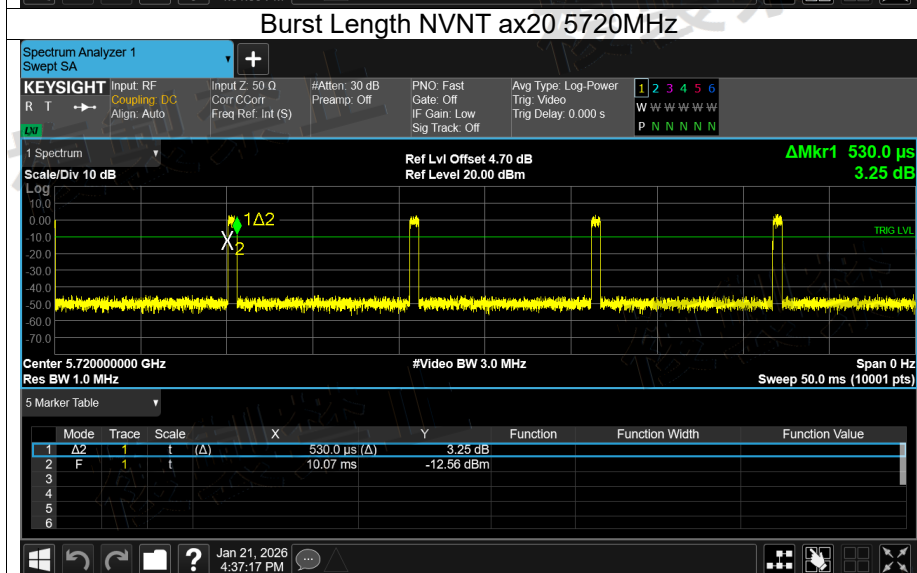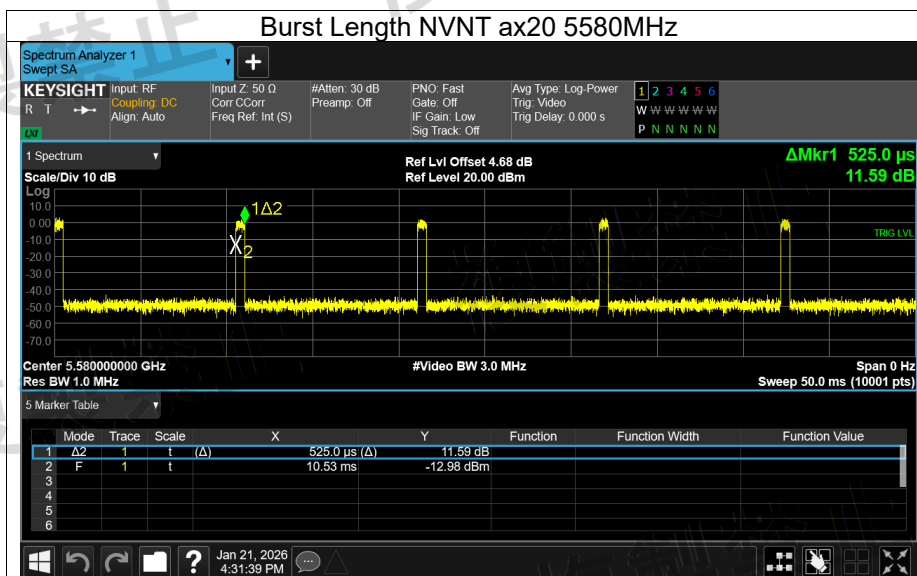

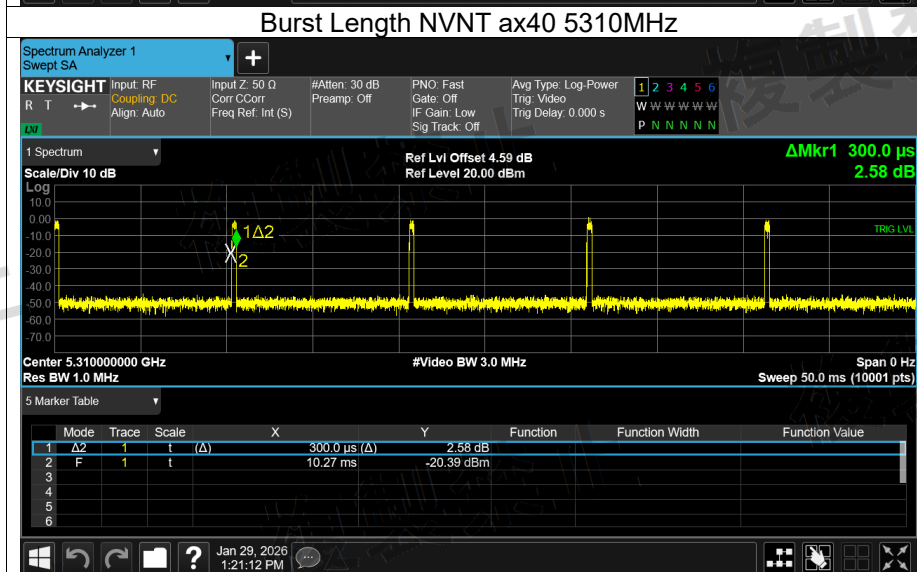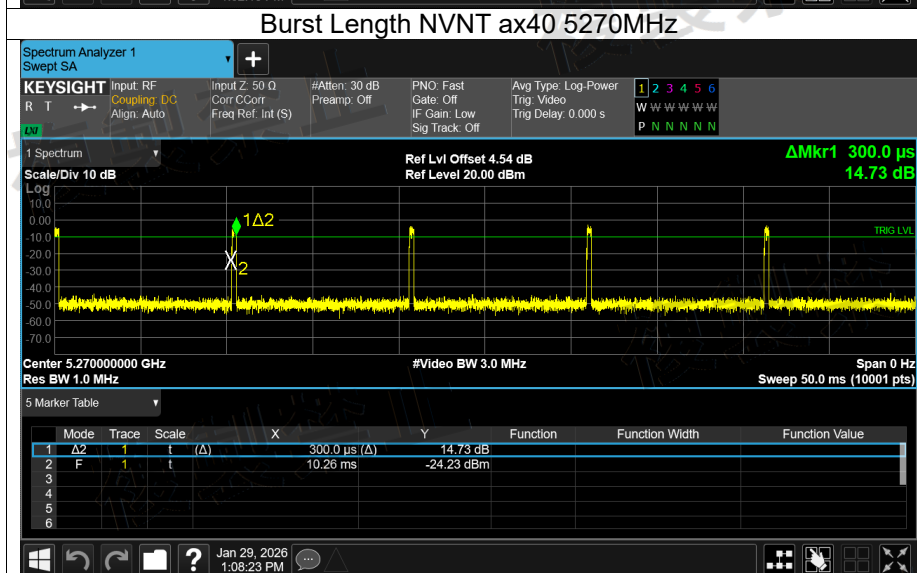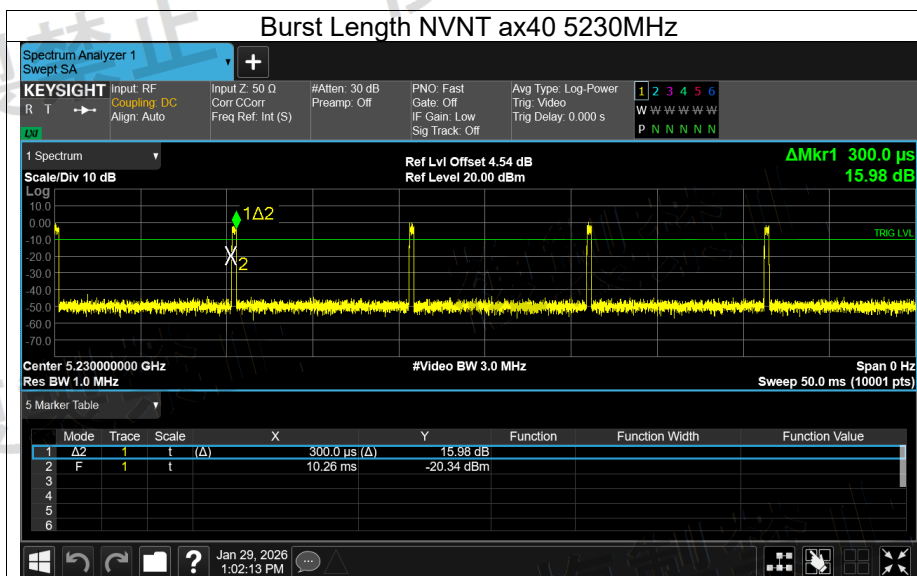

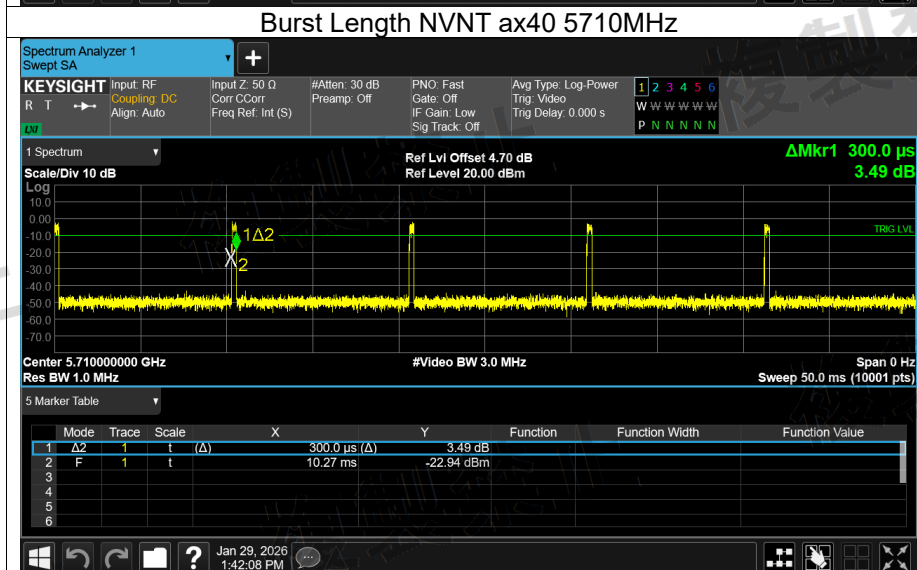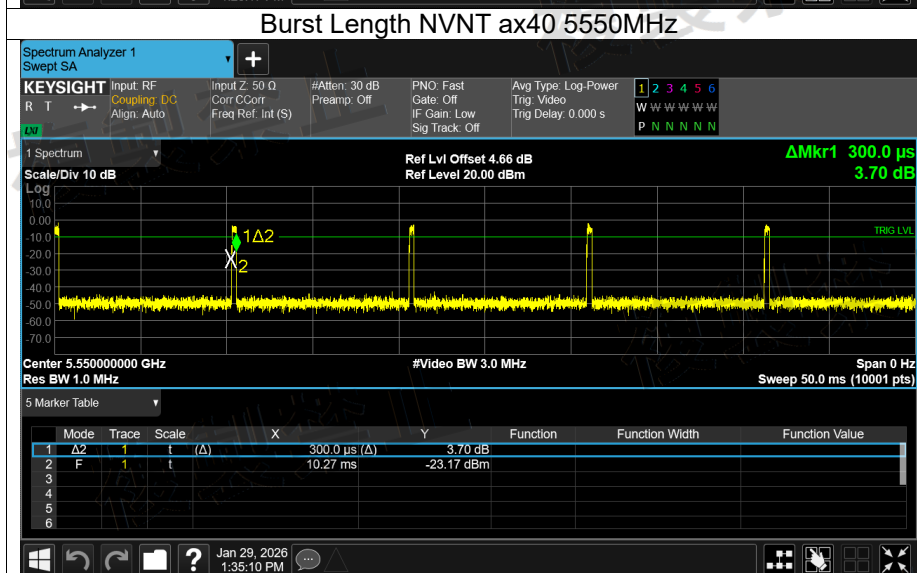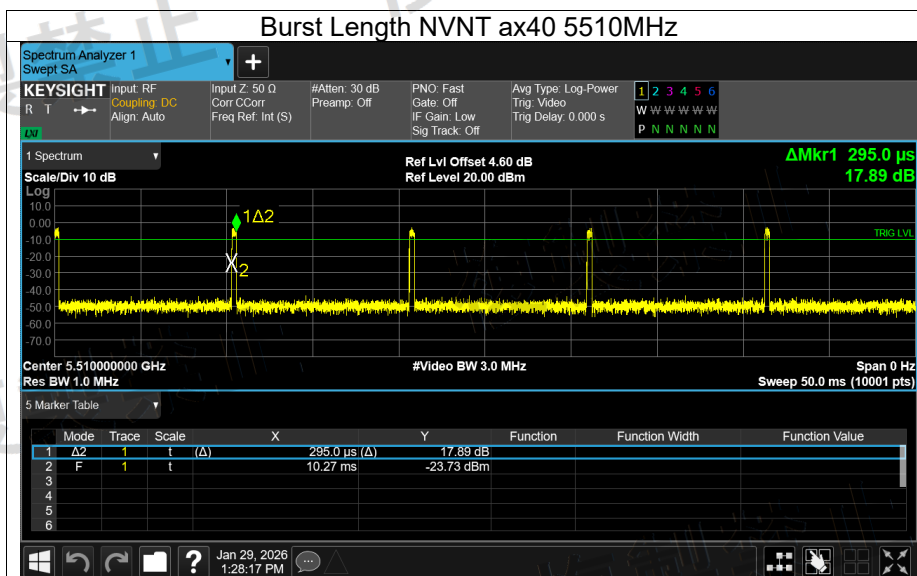



RX SPURIOUS EMISSION




Condition	Mode	Frequency (MHz)	Range (MHz)	Emission Frequency (MHz)	Max Peak Value (dBm)	Max RMS Value (dBm)	Max Peak Value (nW)	Max RMS Value (nW)	Limit (nW)	Verdict
NVNT	a	5180	30-1000	450.01	-76.67	NA	0.0215	NA	4	Pass
NVNT	a	5180	1000-26000	2450.00	-52.40	-53.23	5.7544	4.7534	20	Pass
NVNT	a	5200	30-1000	450.01	-76.74	NA	0.0212	NA	4	Pass
NVNT	a	5200	1000-26000	2450.00	-54.30	-60.4	3.7154	0.912	20	Pass
NVNT	a	5240	30-1000	450.01	-77.19	NA	0.0191	NA	4	Pass
NVNT	a	5240	1000-26000	4575.00	-59.09	NA	1.2331	NA	20	Pass
NVNT	a	5260	30-1000	450.01	-77.21	NA	0.019	NA	4	Pass
NVNT	a	5260	1000-26000	2625.00	-55.43	-82.53	2.8642	0.0056	20	Pass
NVNT	a	5300	30-1000	450.01	-77.40	NA	0.0182	NA	4	Pass
NVNT	a	5300	1000-26000	4575.00	-59.17	NA	1.2106	NA	20	Pass
NVNT	a	5320	30-1000	359.80	-77.18	NA	0.0191	NA	4	Pass
NVNT	a	5320	1000-26000	4575.00	-59.19	NA	1.205	NA	20	Pass
NVNT	a	5500	30-1000	450.01	-78.17	NA	0.0152	NA	4	Pass
NVNT	a	5500	1000-26000	4575.00	-59.24	NA	1.1912	NA	20	Pass
NVNT	a	5580	30-1000	450.01	-77.54	NA	0.0176	NA	4	Pass
NVNT	a	5580	1000-26000	4575.00	-59.08	NA	1.2359	NA	20	Pass
NVNT	a	5720	30-1000	450.01	-77.77	NA	0.0167	NA	4	Pass
NVNT	a	5720	1000-26000	4575.00	-59.19	NA	1.205	NA	20	Pass
NVNT	n20	5180	30-1000	450.01	-77.65	NA	0.0172	NA	4	Pass
NVNT	n20	5180	1000-26000	4575.00	-59.13	NA	1.2218	NA	20	Pass
NVNT	n20	5200	30-1000	450.01	-77.63	NA	0.0173	NA	4	Pass
NVNT	n20	5200	1000-26000	4575.00	-59.15	NA	1.2162	NA	20	Pass
NVNT	n20	5240	30-1000	359.80	-77.17	NA	0.0192	NA	4	Pass
NVNT	n20	5240	1000-26000	4575.00	-59.10	NA	1.2303	NA	20	Pass
NVNT	n20	5260	30-1000	825.40	-65.52	NA	0.2805	NA	4	Pass
NVNT	n20	5260	1000-26000	4575.00	-59.03	NA	1.2503	NA	20	Pass
NVNT	n20	5300	30-1000	450.01	-76.46	NA	0.0226	NA	4	Pass
NVNT	n20	5300	1000-26000	4575.00	-59.20	NA	1.2023	NA	20	Pass
NVNT	n20	5320	30-1000	450.01	-77.44	NA	0.018	NA	4	Pass
NVNT	n20	5320	1000-26000	4575.00	-59.25	NA	1.1885	NA	20	Pass
NVNT	n20	5500	30-1000	450.01	-77.40	NA	0.0182	NA	4	Pass
NVNT	n20	5500	1000-26000	4575.00	-59.24	NA	1.1912	NA	20	Pass
NVNT	n20	5580	30-1000	450.01	-76.61	NA	0.0218	NA	4	Pass
NVNT	n20	5580	1000-26000	4575.00	-59.02	NA	1.2531	NA	20	Pass
NVNT	n20	5720	30-1000	450.01	-77.20	NA	0.0191	NA	4	Pass
NVNT	n20	5720	1000-26000	4575.00	-59.04	NA	1.2474	NA	20	Pass
NVNT	n40	5190	30-1000	450.01	-77.40	NA	0.0182	NA	4	Pass
NVNT	n40	5190	1000-	4575.00	-59.15	NA	1.2162	NA	20	Pass









NVNT	n40	5230	26000 30-1000	450.01	-77.36	NA	0.0184	NA	4	Pass
NVNT	n40	5230	1000- 26000	4575.00	-59.16	NA	1.2134	NA	20	Pass
NVNT	n40	5270	30-1000	450.01	-77.12	NA	0.0194	NA	4	Pass
NVNT	n40	5270	1000- 26000	4575.00	-59.07	NA	1.2388	NA	20	Pass
NVNT	n40	5310	30-1000	450.01	-77.76	NA	0.0167	NA	4	Pass
NVNT	n40	5310	1000- 26000	4575.00	-59.23	NA	1.194	NA	20	Pass
NVNT	n40	5510	30-1000	450.01	-77.10	NA	0.0195	NA	4	Pass
NVNT	n40	5510	1000- 26000	4575.00	-59.16	NA	1.2134	NA	20	Pass
NVNT	n40	5550	30-1000	450.01	-77.20	NA	0.0191	NA	4	Pass
NVNT	n40	5550	1000- 26000	4575.00	-59.12	NA	1.2246	NA	20	Pass
NVNT	n40	5710	30-1000	866.14	-75.48	NA	0.0283	NA	4	Pass
NVNT	n40	5710	1000- 26000	4575.00	-59.00	NA	1.2589	NA	20	Pass
NVNT	ac20	5180	30-1000	450.01	-77.58	NA	0.0175	NA	4	Pass
NVNT	ac20	5180	1000- 26000	4575.00	-59.27	NA	1.183	NA	20	Pass
NVNT	ac20	5200	30-1000	450.01	-77.74	NA	0.0168	NA	4	Pass
NVNT	ac20	5200	1000- 26000	4575.00	-59.23	NA	1.194	NA	20	Pass
NVNT	ac20	5240	30-1000	705.12	-74.20	NA	0.038	NA	4	Pass
NVNT	ac20	5240	1000- 26000	4575.00	-59.17	NA	1.2106	NA	20	Pass
NVNT	ac20	5260	30-1000	399.57	-78.01	NA	0.0158	NA	4	Pass
NVNT	ac20	5260	1000- 26000	4575.00	-59.26	NA	1.1858	NA	20	Pass
NVNT	ac20	5300	30-1000	450.01	-78.03	NA	0.0157	NA	4	Pass
NVNT	ac20	5300	1000- 26000	4575.00	-59.28	NA	1.1803	NA	20	Pass
NVNT	ac20	5320	30-1000	450.01	-77.48	NA	0.0179	NA	4	Pass
NVNT	ac20	5320	1000- 26000	4575.00	-59.26	NA	1.1858	NA	20	Pass
NVNT	ac20	5500	30-1000	450.01	-77.69	NA	0.017	NA	4	Pass
NVNT	ac20	5500	1000- 26000	4575.00	-59.20	NA	1.2023	NA	20	Pass
NVNT	ac20	5580	30-1000	450.01	-77.22	NA	0.019	NA	4	Pass
NVNT	ac20	5580	1000- 26000	4575.00	-59.14	NA	1.219	NA	20	Pass
NVNT	ac20	5720	30-1000	359.80	-77.29	NA	0.0187	NA	4	Pass
NVNT	ac20	5720	1000- 26000	4575.00	-59.21	NA	1.1995	NA	20	Pass
NVNT	ac40	5190	30-1000	866.14	-70.08	NA	0.0982	NA	4	Pass
NVNT	ac40	5190	1000- 26000	4575.00	-59.09	NA	1.2331	NA	20	Pass
NVNT	ac40	5230	30-1000	399.57	-77.93	NA	0.0161	NA	4	Pass
NVNT	ac40	5230	1000- 26000	4575.00	-59.37	NA	1.1561	NA	20	Pass
NVNT	ac40	5270	30-1000	450.01	-77.27	NA	0.0187	NA	4	Pass
NVNT	ac40	5270	1000- 26000	4575.00	-59.09	NA	1.2331	NA	20	Pass
NVNT	ac40	5310	30-1000	450.01	-77.63	NA	0.0173	NA	4	Pass
NVNT	ac40	5310	1000- 26000	4575.00	-59.39	NA	1.1508	NA	20	Pass
NVNT	ac40	5510	30-1000	359.80	-76.58	NA	0.022	NA	4	Pass
NVNT	ac40	5510	1000- 26000	4575.00	-59.35	NA	1.1614	NA	20	Pass
NVNT	ac40	5550	30-1000	359.80	-77.08	NA	0.0196	NA	4	Pass









NVNT	ac40	5550	1000-26000	4575.00	-59.37	NA	1.1561	NA	20	Pass
NVNT	ac40	5710	30-1000	450.01	-77.19	NA	0.0191	NA	4	Pass
NVNT	ac40	5710	1000-26000	4575.00	-59.20	NA	1.2023	NA	20	Pass
NVNT	ax20	5180	30-1000	450.01	-76.85	NA	0.0207	NA	4	Pass
NVNT	ax20	5180	1000-26000	4575.00	-59.18	NA	1.2078	NA	20	Pass
NVNT	ax20	5200	30-1000	359.80	-76.66	NA	0.0216	NA	4	Pass
NVNT	ax20	5200	1000-26000	4575.00	-59.13	NA	1.2218	NA	20	Pass
NVNT	ax20	5240	30-1000	450.01	-77.56	NA	0.0175	NA	4	Pass
NVNT	ax20	5240	1000-26000	4575.00	-59.18	NA	1.2078	NA	20	Pass
NVNT	ax20	5260	30-1000	450.01	-77.06	NA	0.0197	NA	4	Pass
NVNT	ax20	5260	1000-26000	4575.00	-59.24	NA	1.1912	NA	20	Pass
NVNT	ax20	5300	30-1000	450.01	-77.47	NA	0.0179	NA	4	Pass
NVNT	ax20	5300	1000-26000	4575.00	-59.10	NA	1.2303	NA	20	Pass
NVNT	ax20	5320	30-1000	450.01	-77.55	NA	0.0176	NA	4	Pass
NVNT	ax20	5320	1000-26000	4575.00	-59.07	NA	1.2388	NA	20	Pass
NVNT	ax20	5500	30-1000	399.57	-77.78	NA	0.0167	NA	4	Pass
NVNT	ax20	5500	1000-26000	4575.00	-59.03	NA	1.2503	NA	20	Pass
NVNT	ax20	5580	30-1000	866.14	-68.50	NA	0.1413	NA	4	Pass
NVNT	ax20	5580	1000-26000	4575.00	-59.16	NA	1.2134	NA	20	Pass
NVNT	ax20	5720	30-1000	866.14	-70.07	NA	0.0984	NA	4	Pass
NVNT	ax20	5720	1000-26000	2550.00	-52.25	-82.05	5.9566	0.0062	20	Pass
NVNT	ax40	5190	30-1000	450.01	-77.35	NA	0.0184	NA	4	Pass
NVNT	ax40	5190	1000-26000	4575.00	-59.31	NA	1.1722	NA	20	Pass
NVNT	ax40	5230	30-1000	450.01	-77.20	NA	0.0191	NA	4	Pass
NVNT	ax40	5230	1000-26000	4575.00	-59.23	NA	1.194	NA	20	Pass
NVNT	ax40	5270	30-1000	359.80	-76.37	NA	0.0231	NA	4	Pass
NVNT	ax40	5270	1000-26000	4575.00	-59.18	NA	1.2078	NA	20	Pass
NVNT	ax40	5310	30-1000	450.01	-77.72	NA	0.0169	NA	4	Pass
NVNT	ax40	5310	1000-26000	1950.00	-56.95	-59.43	2.0184	1.1402	20	Pass
NVNT	ax40	5510	30-1000	450.01	-77.60	NA	0.0174	NA	4	Pass
NVNT	ax40	5510	1000-26000	4575.00	-59.13	NA	1.2218	NA	20	Pass
NVNT	ax40	5550	30-1000	450.01	-76.97	NA	0.0201	NA	4	Pass
NVNT	ax40	5550	1000-26000	3425.00	-56.66	-84.3	2.1577	0.0037	20	Pass
NVNT	ax40	5710	30-1000	399.57	-77.46	NA	0.0179	NA	4	Pass
NVNT	ax40	5710	1000-26000	4575.00	-59.19	NA	1.205	NA	20	Pass

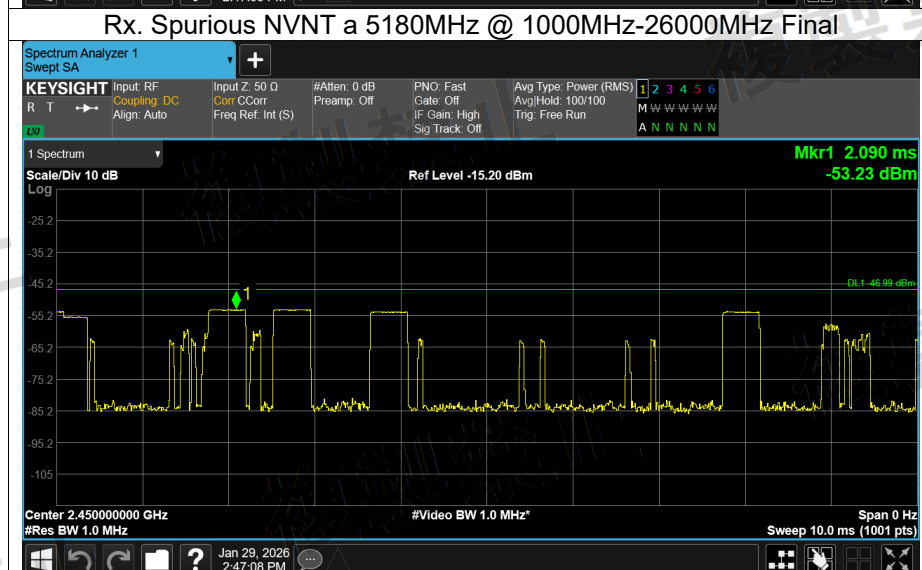
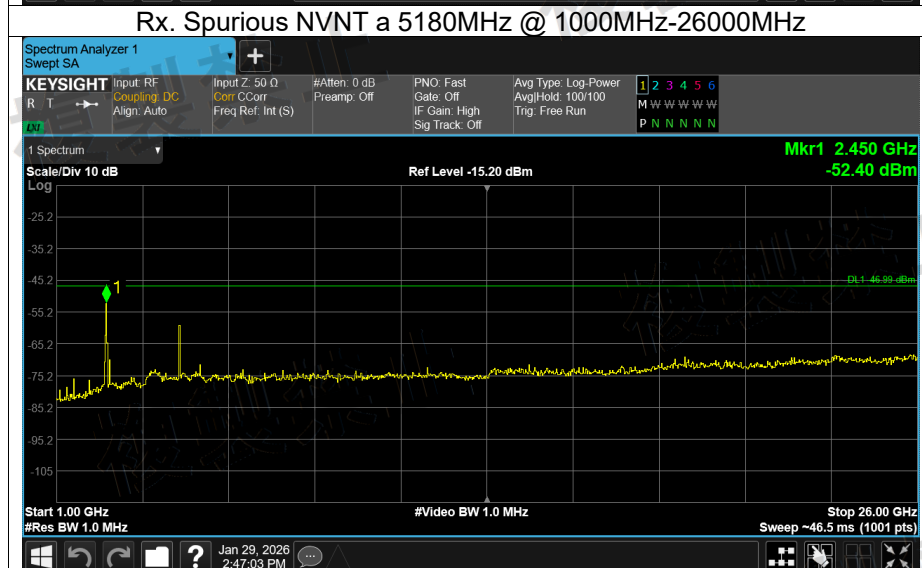
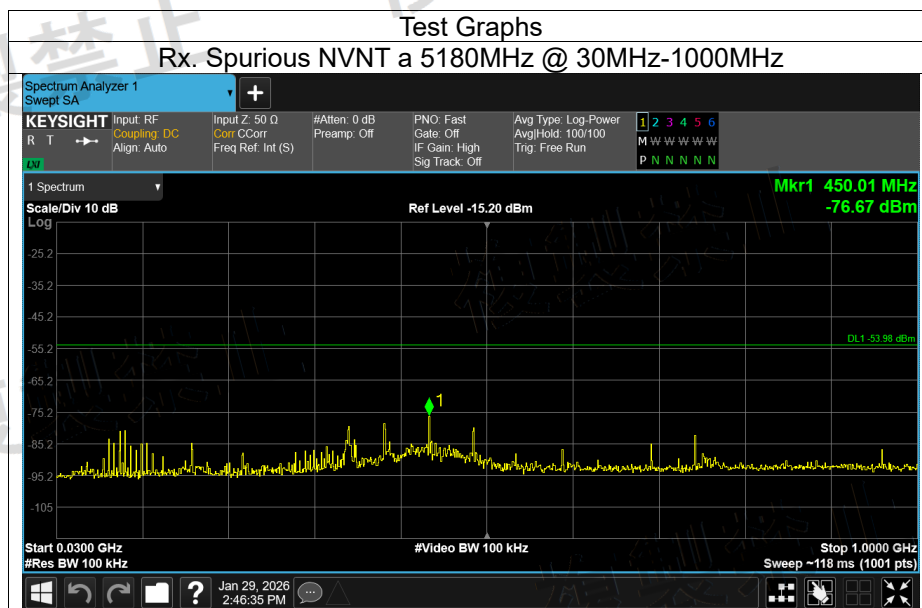


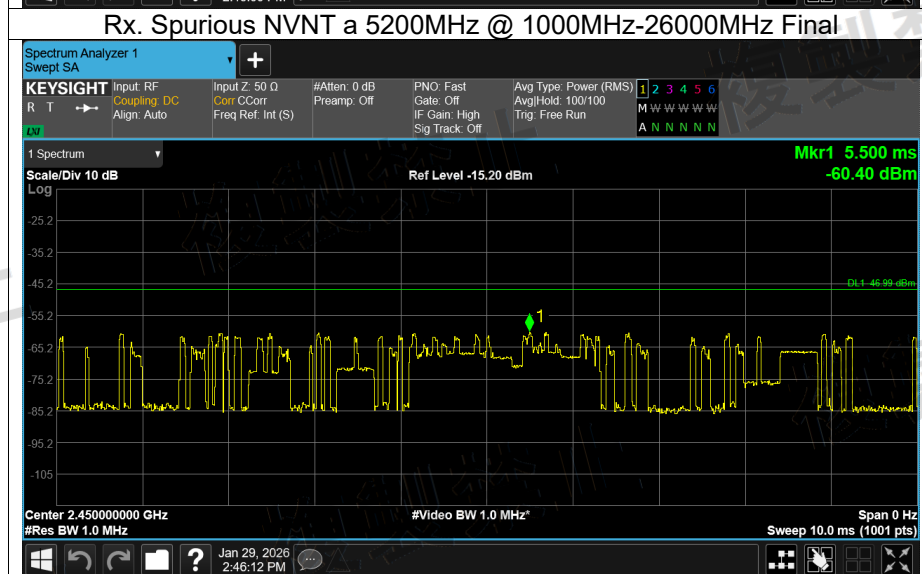
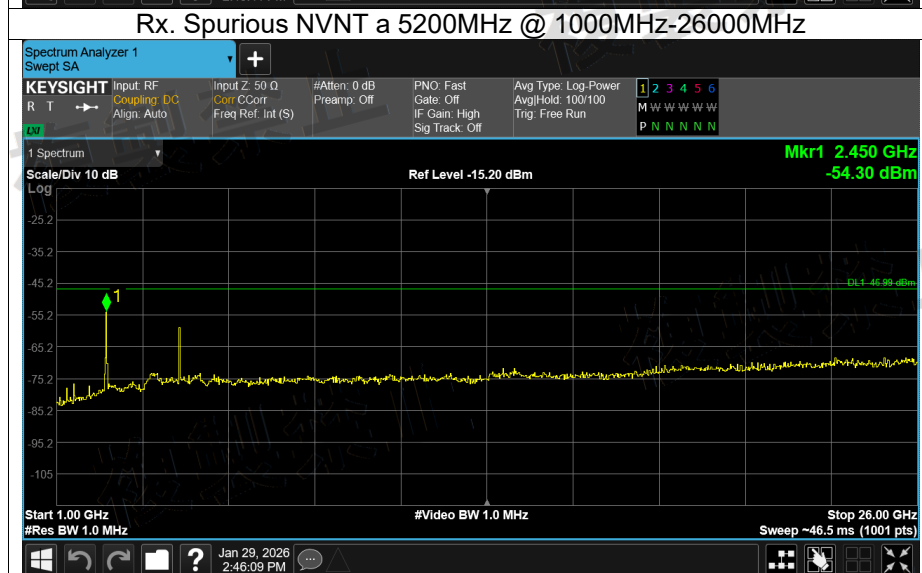
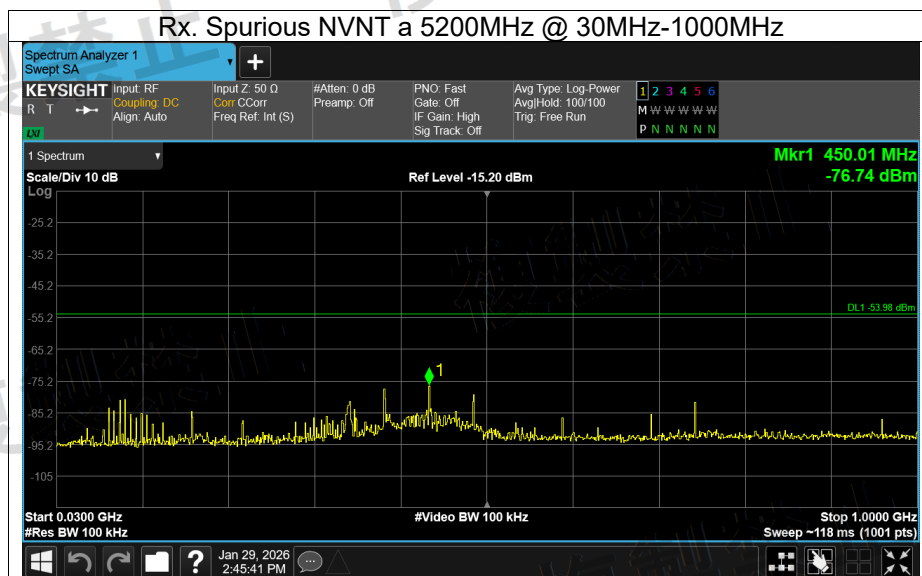


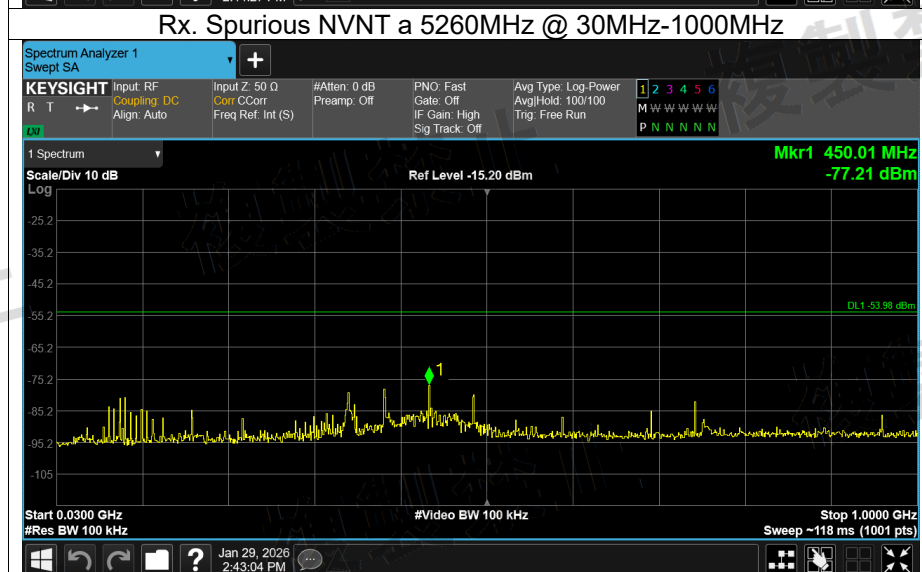
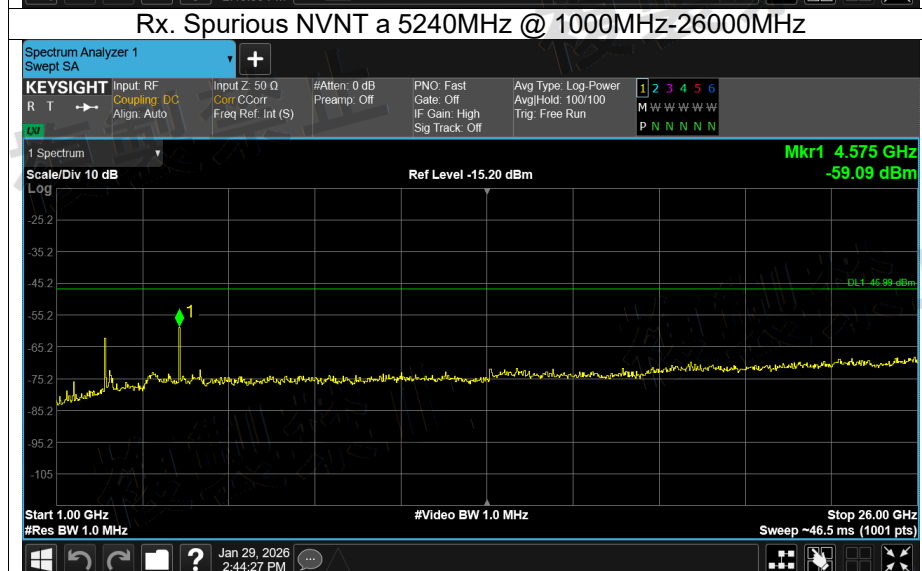
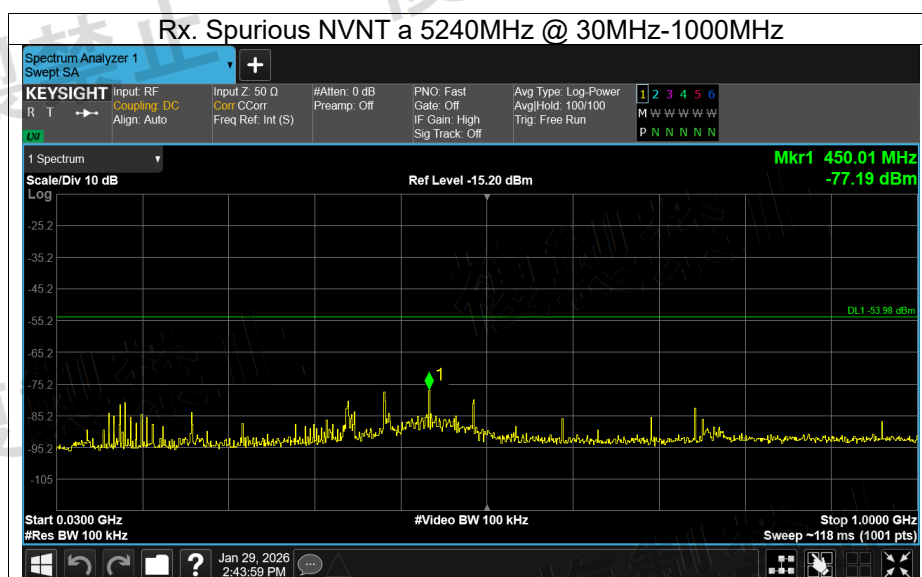


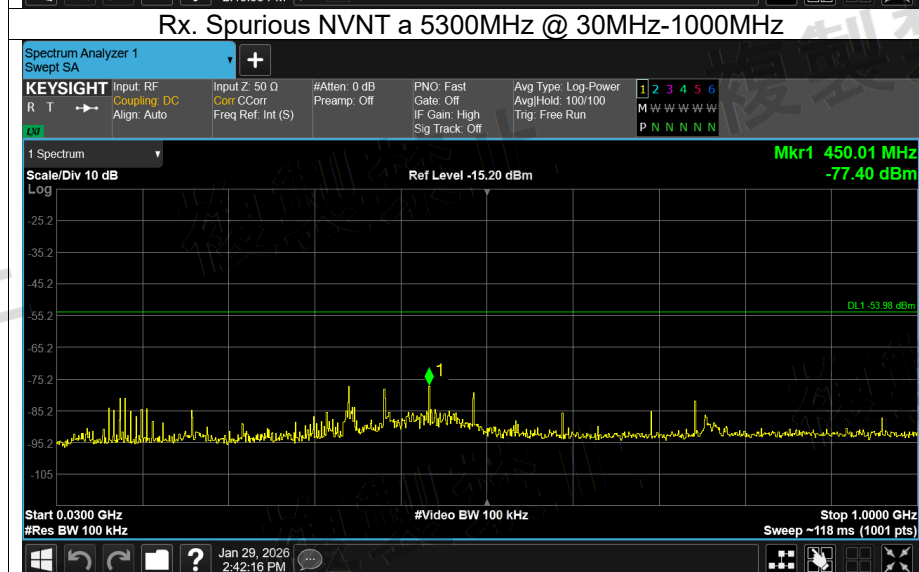
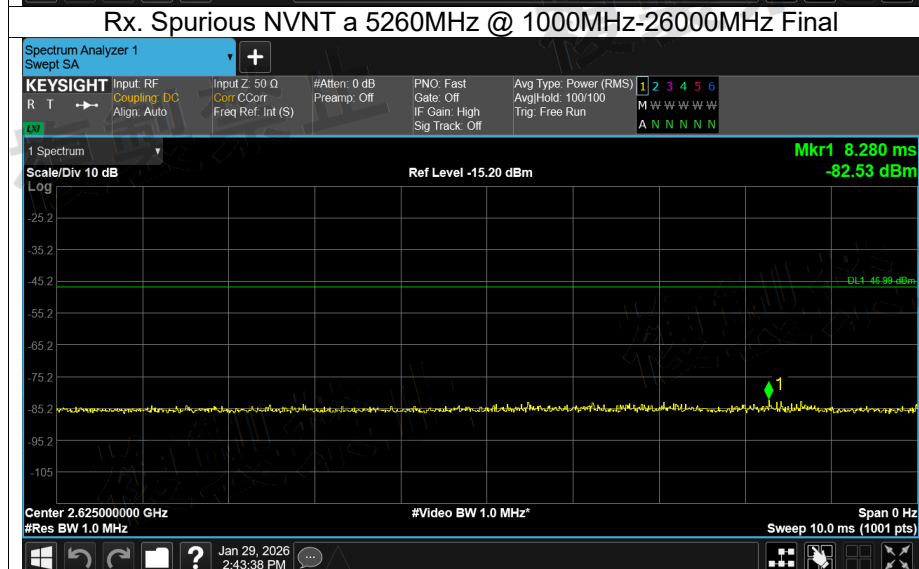
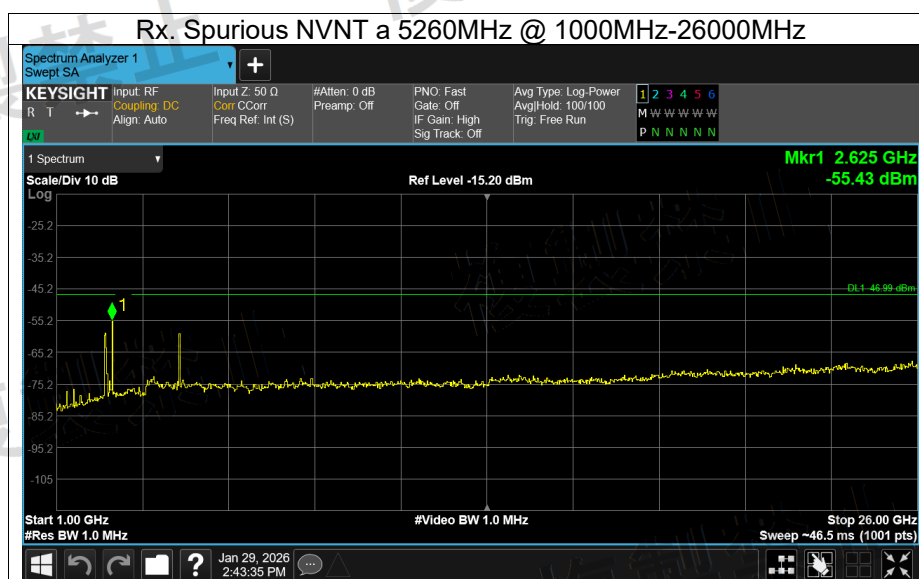


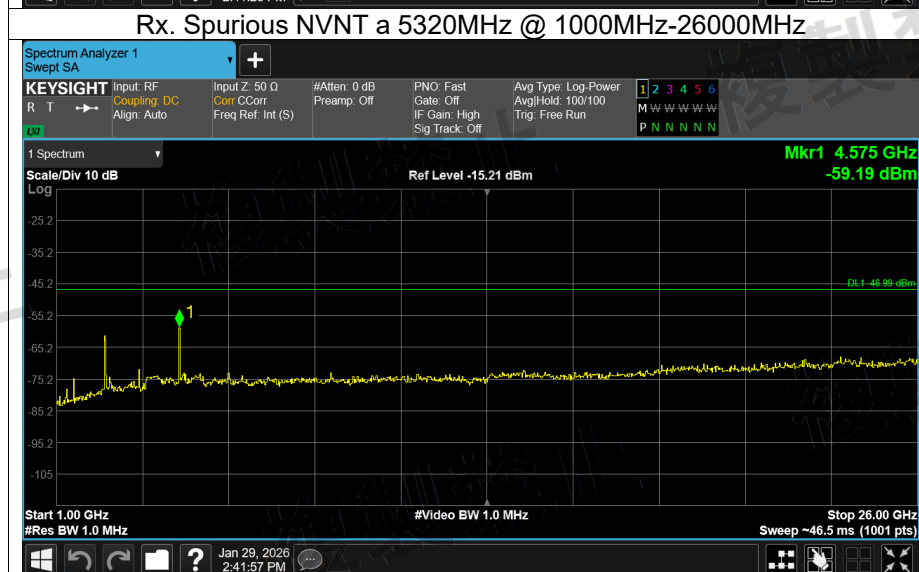
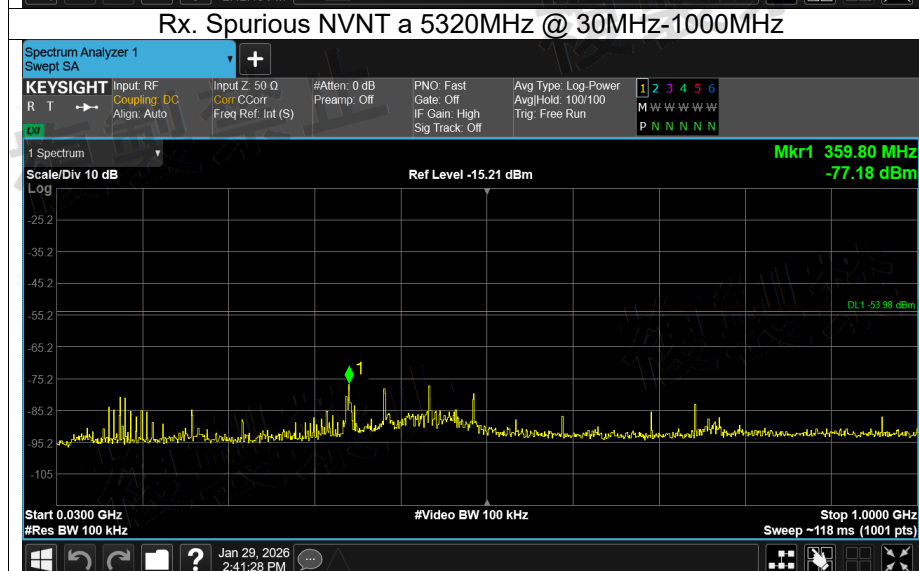
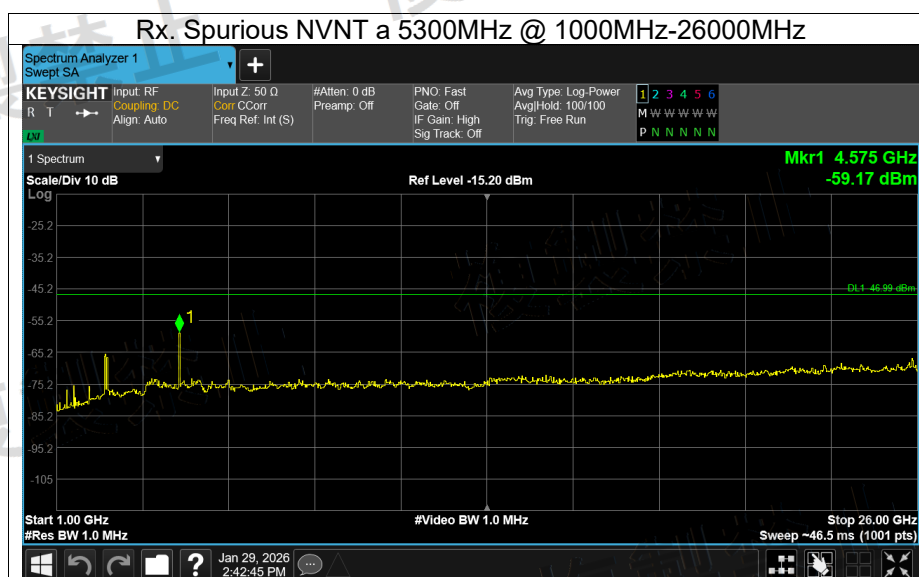


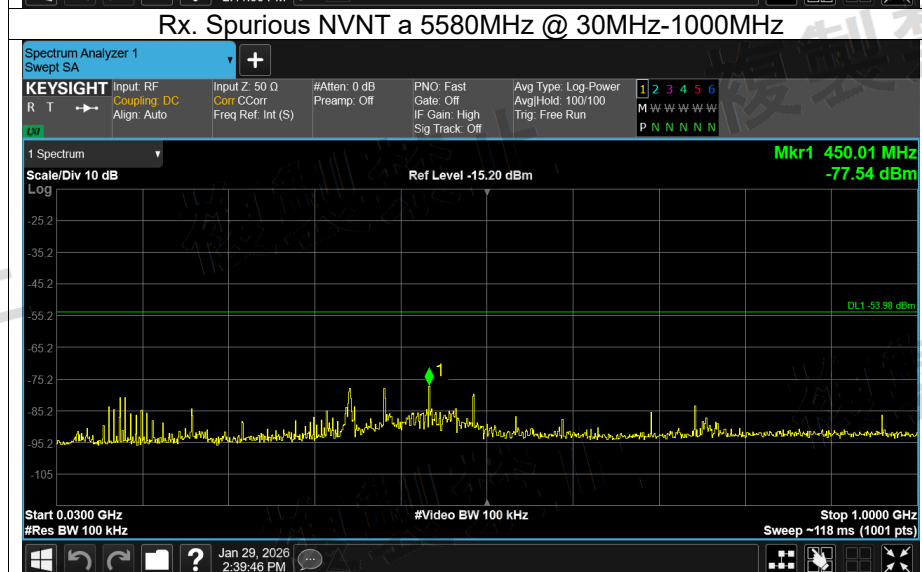
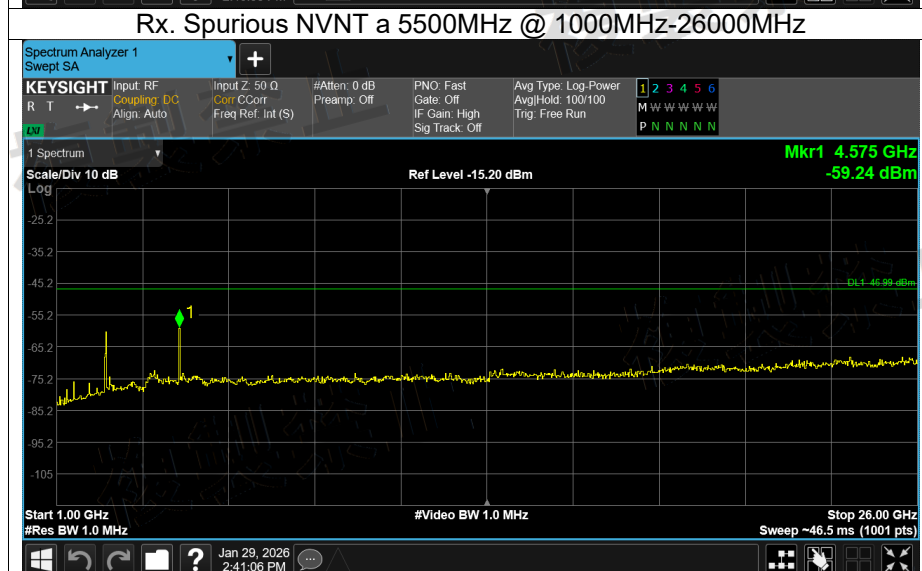
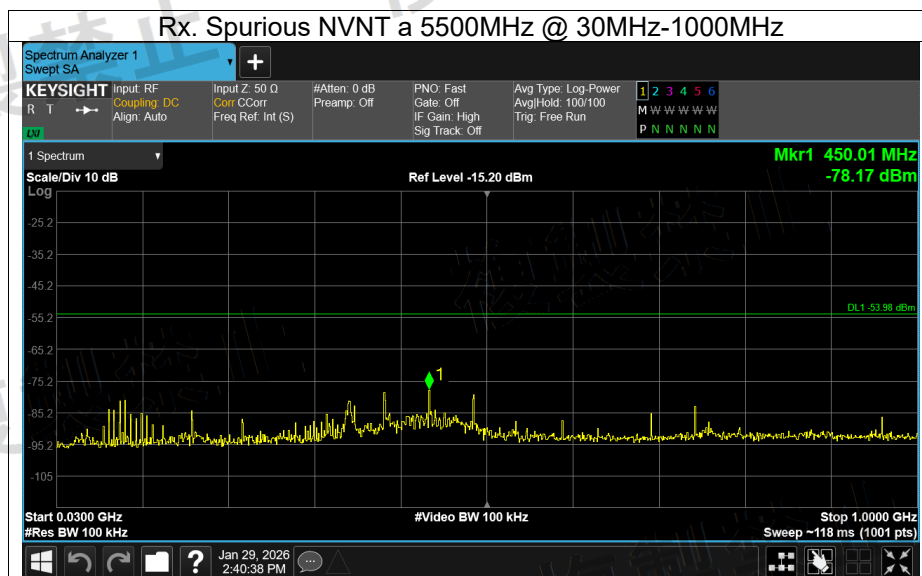


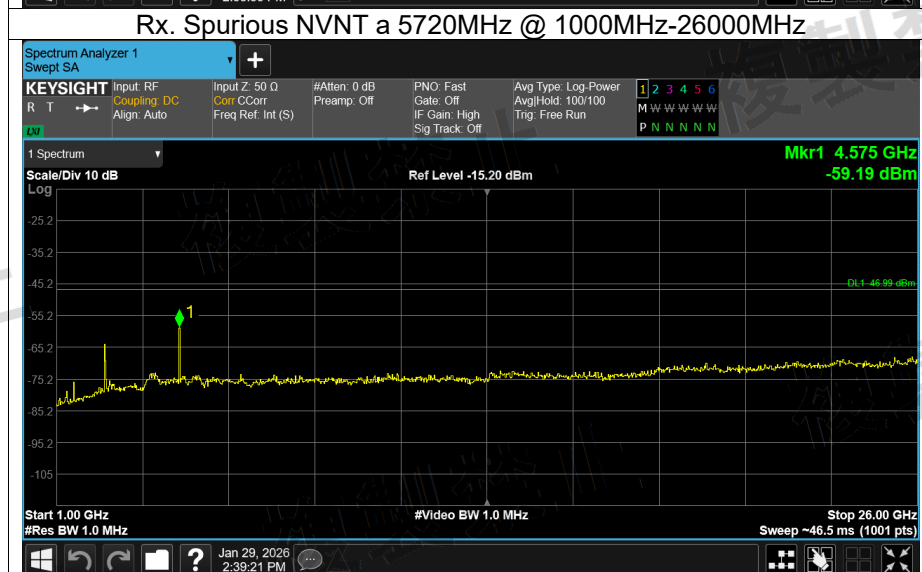
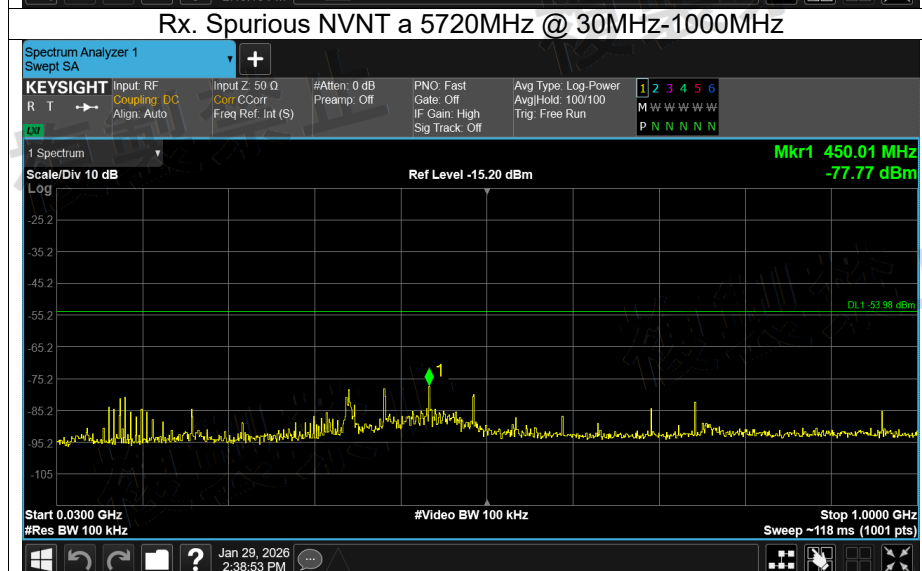
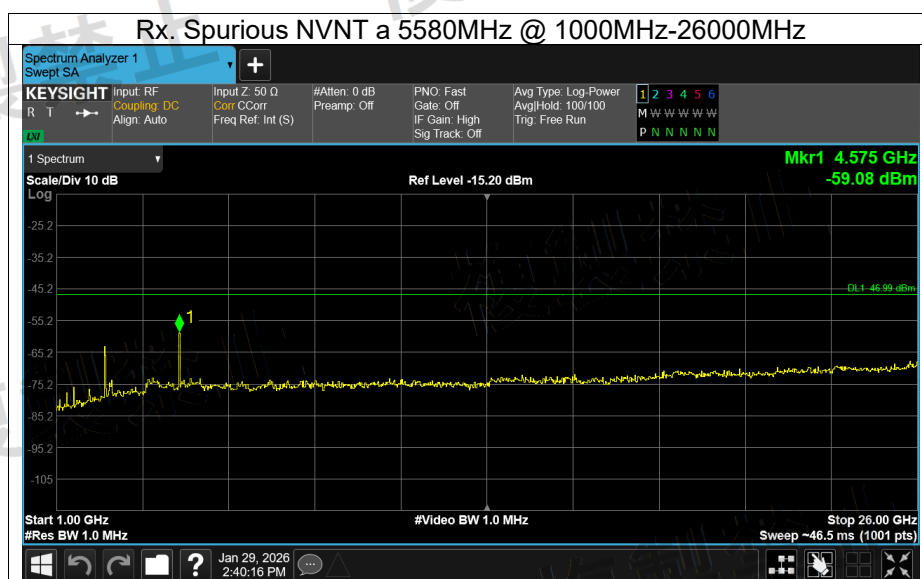


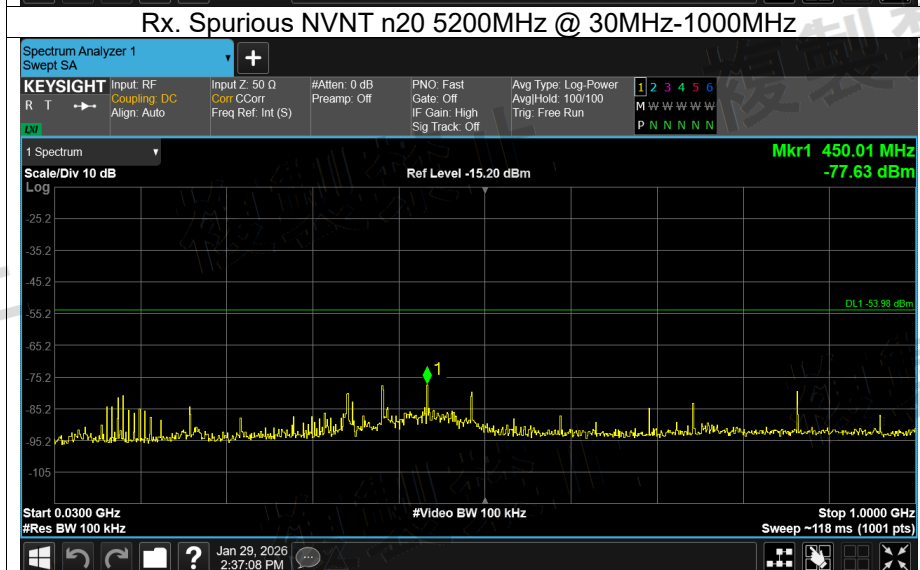
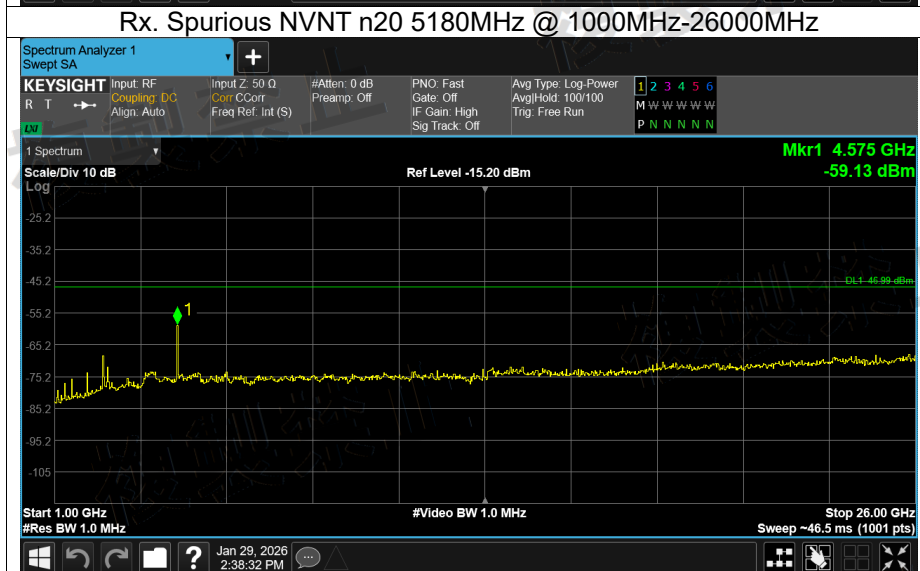
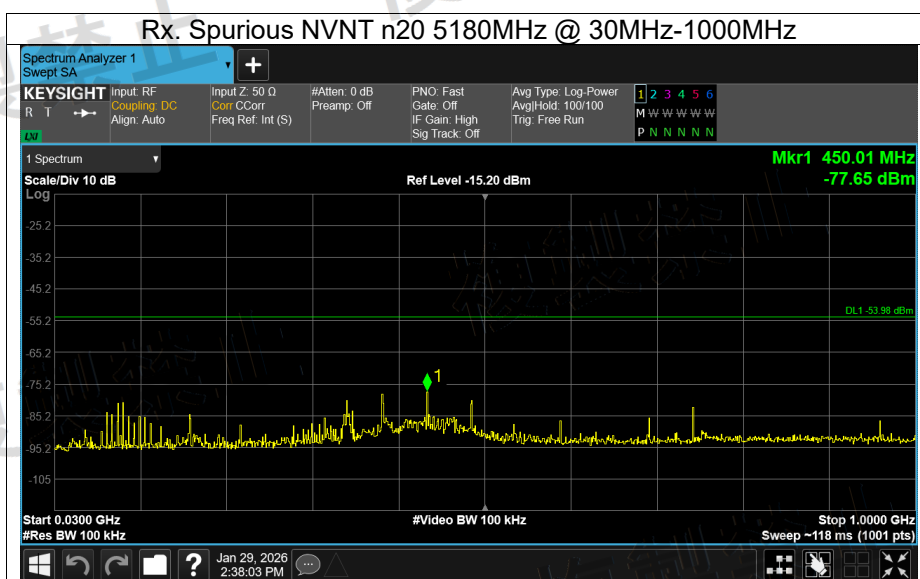


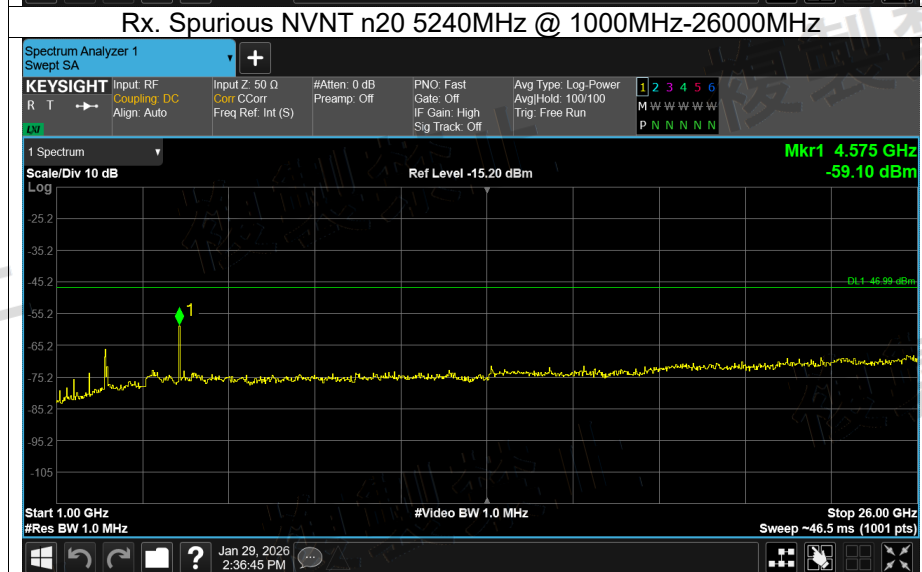
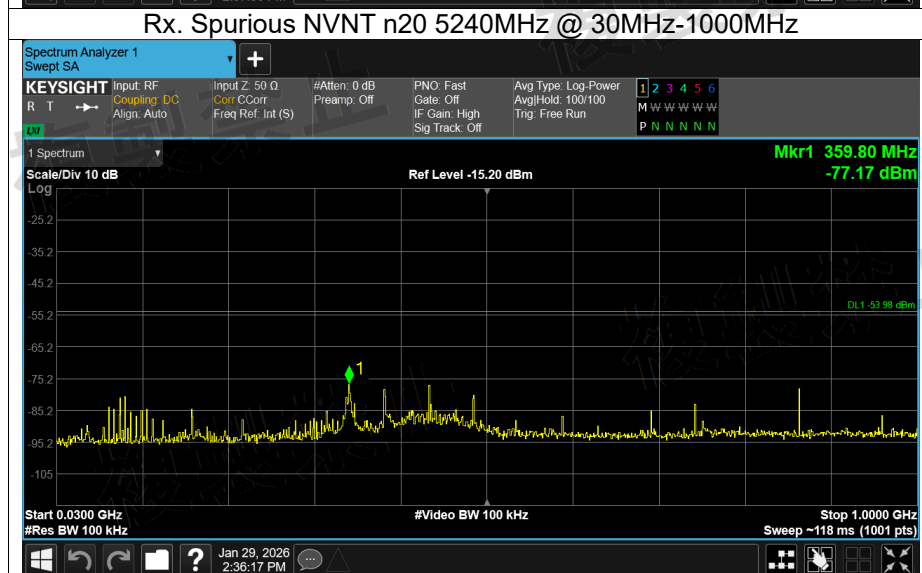
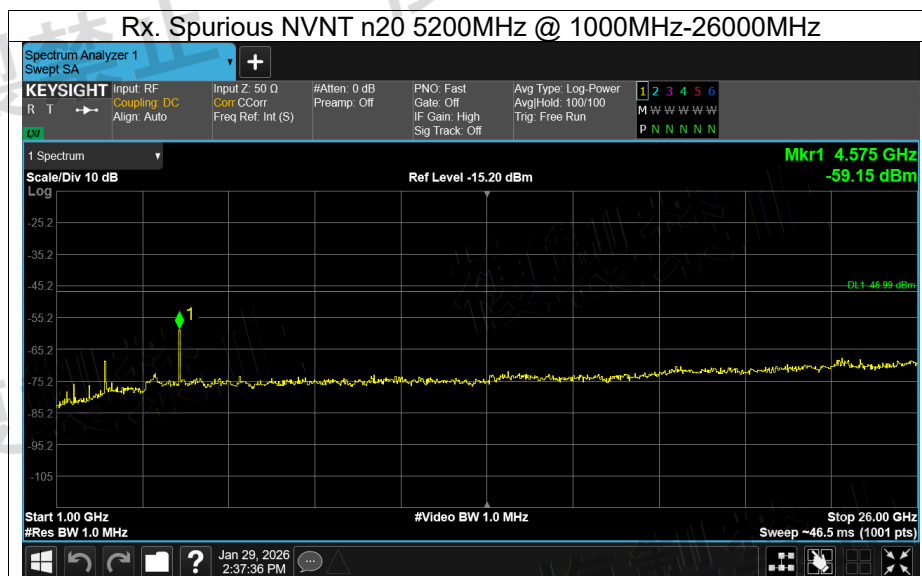


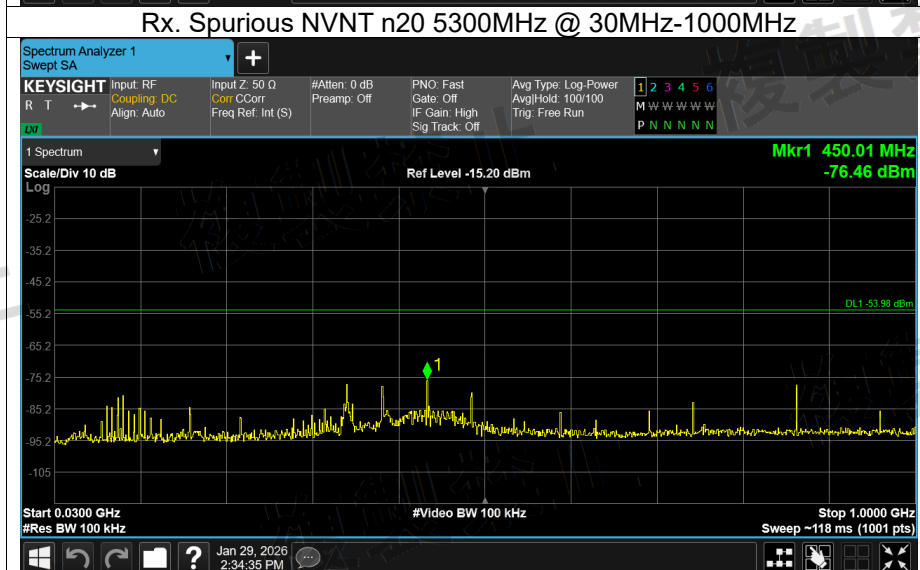
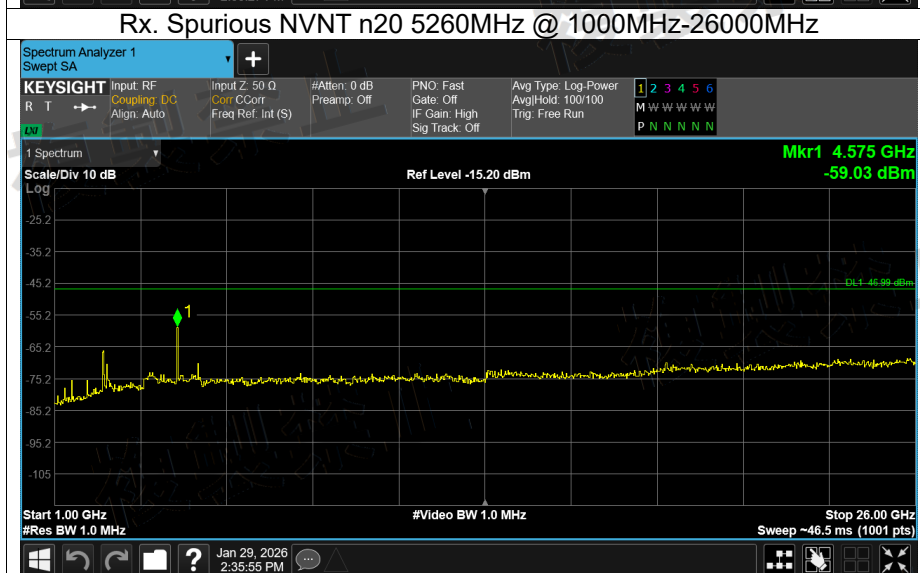
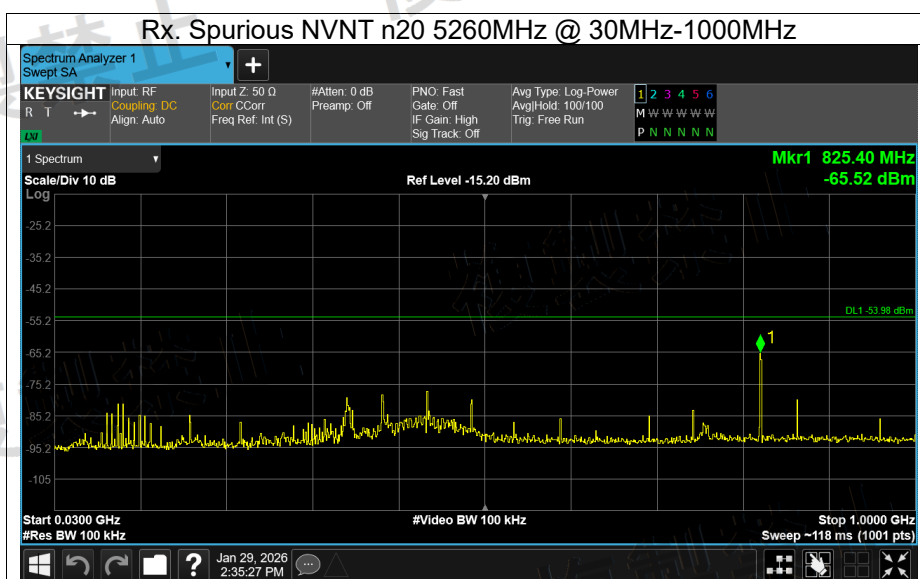


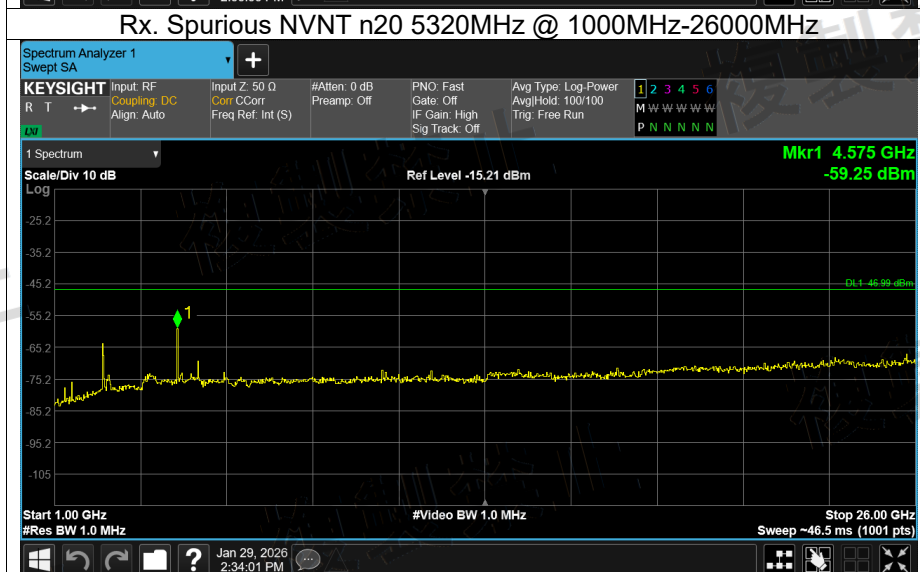
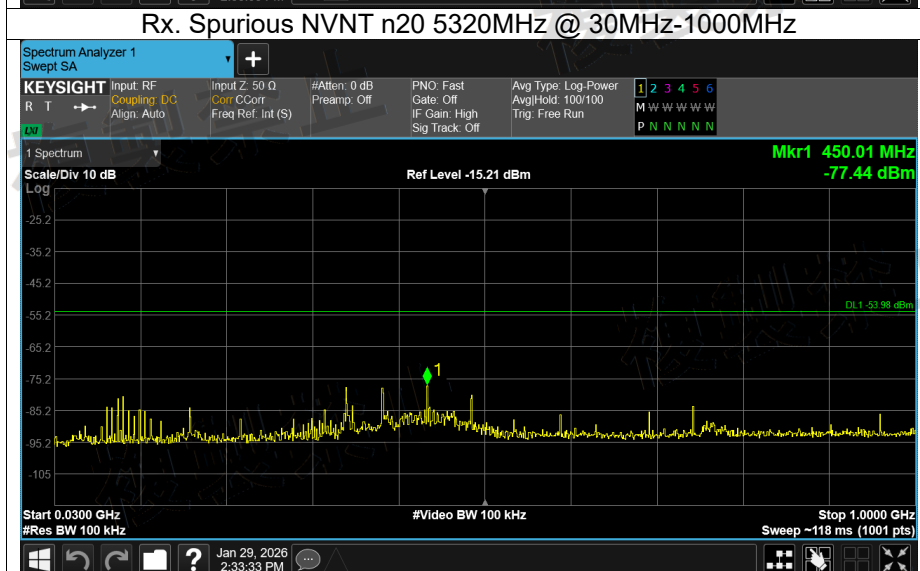
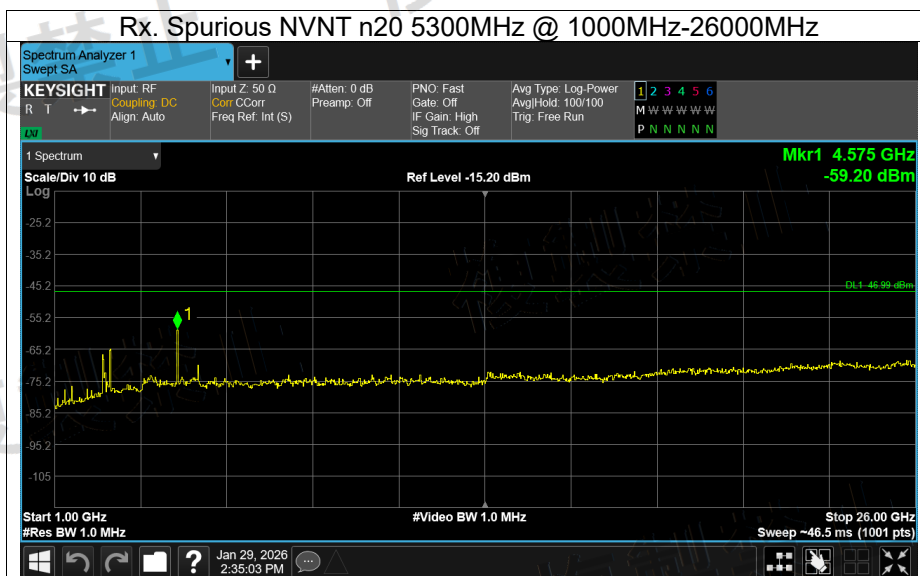


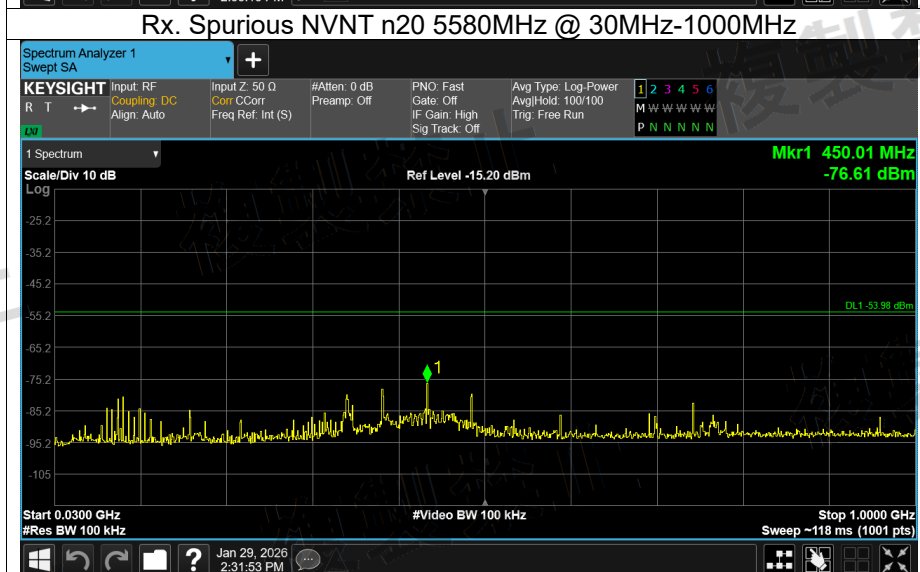
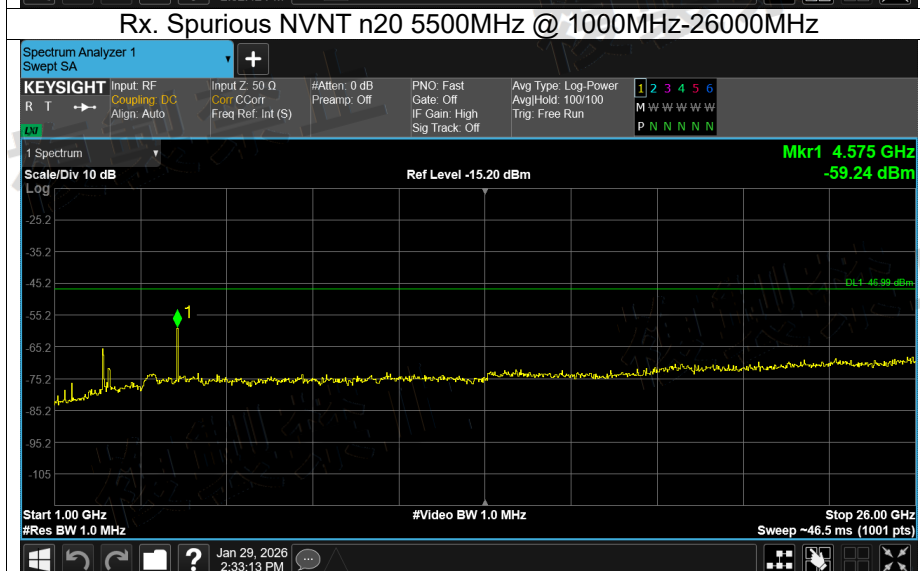
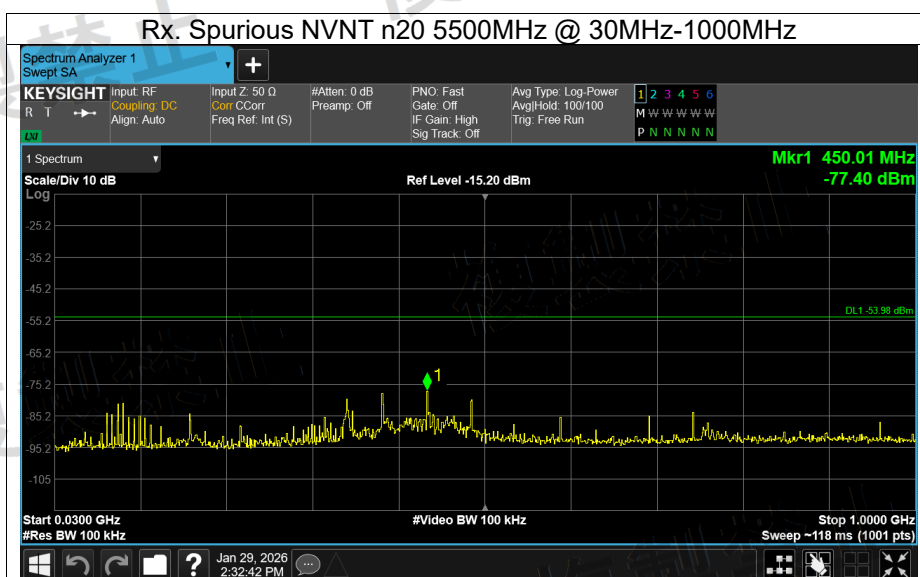


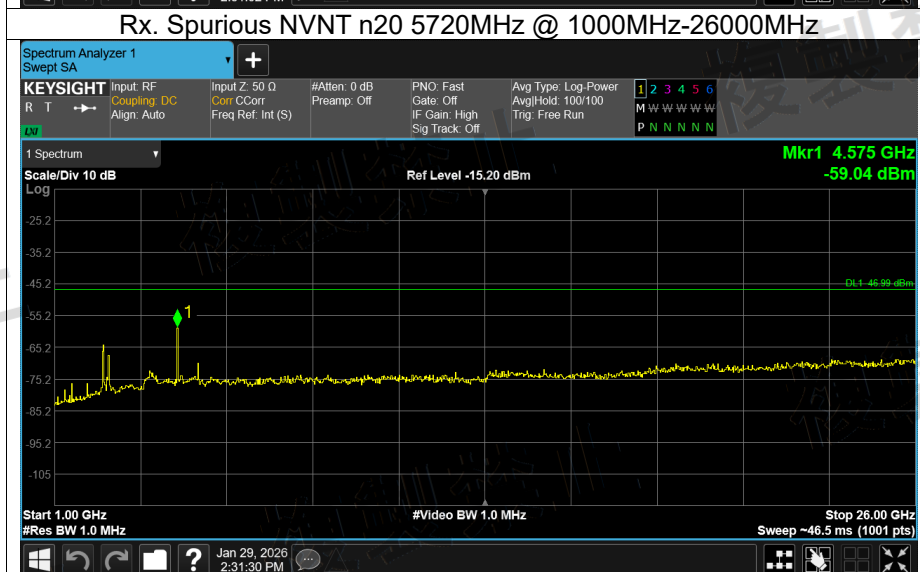
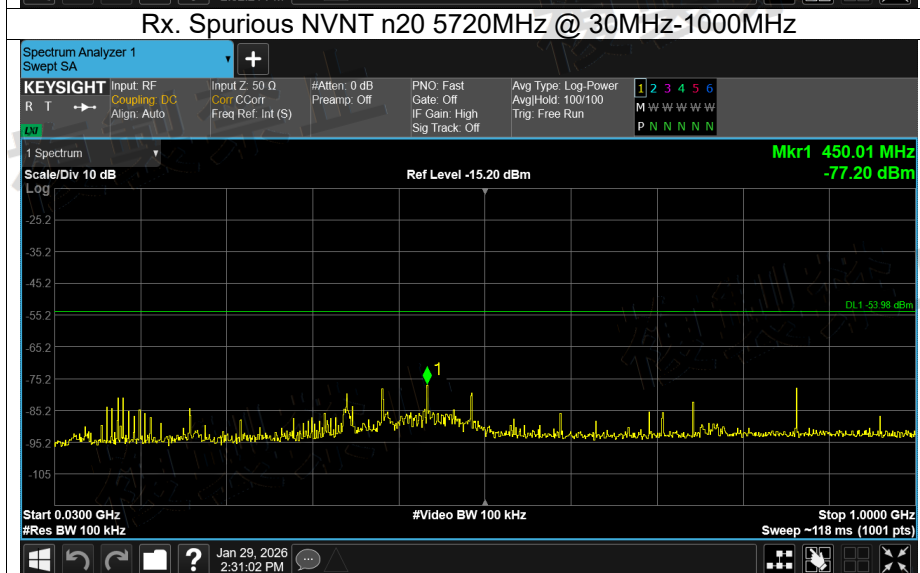
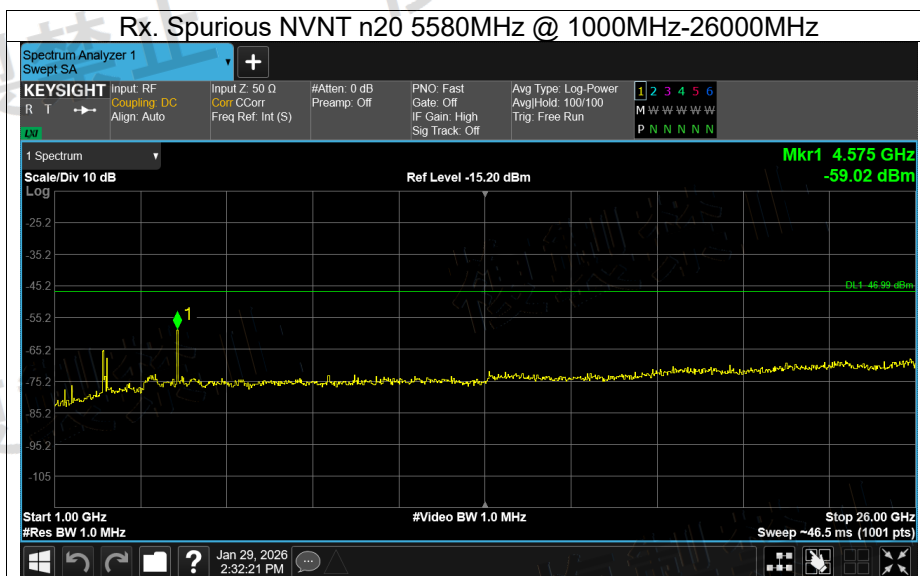


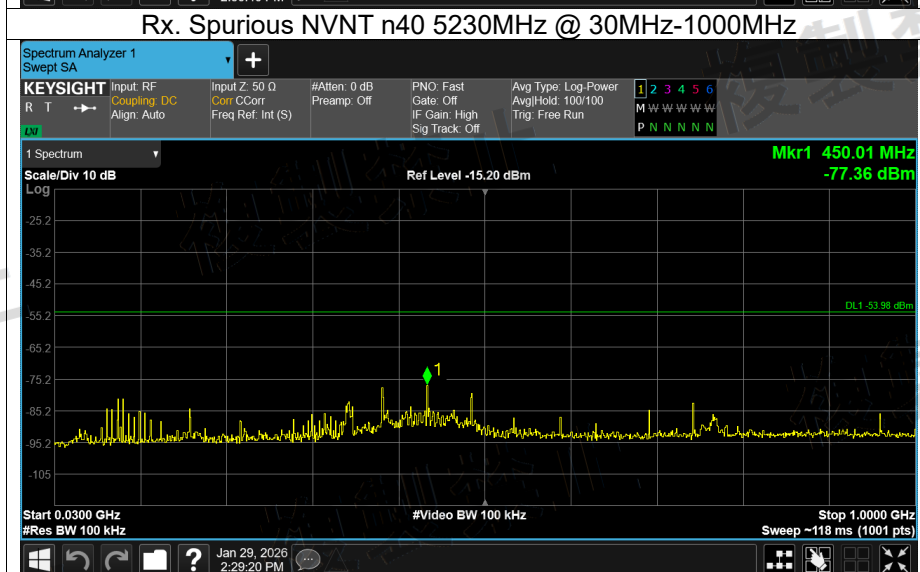
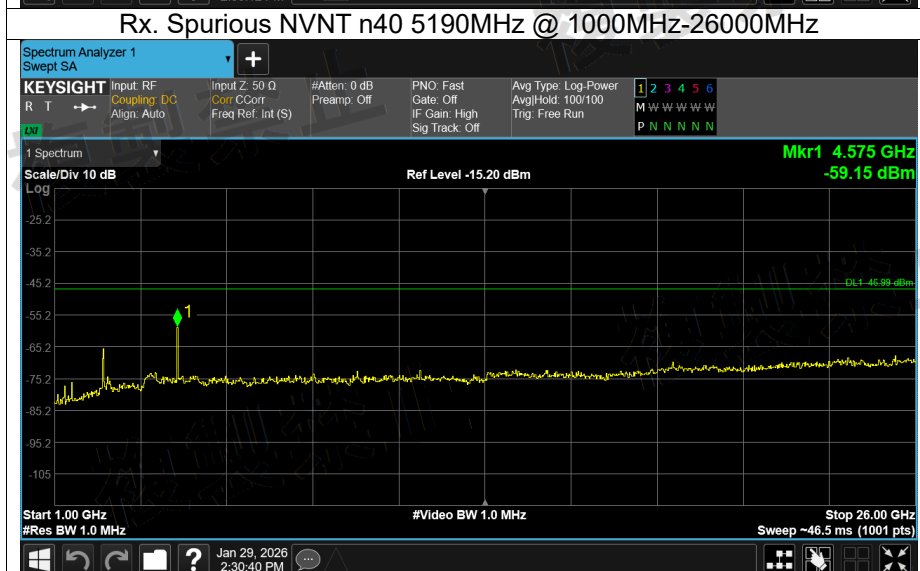
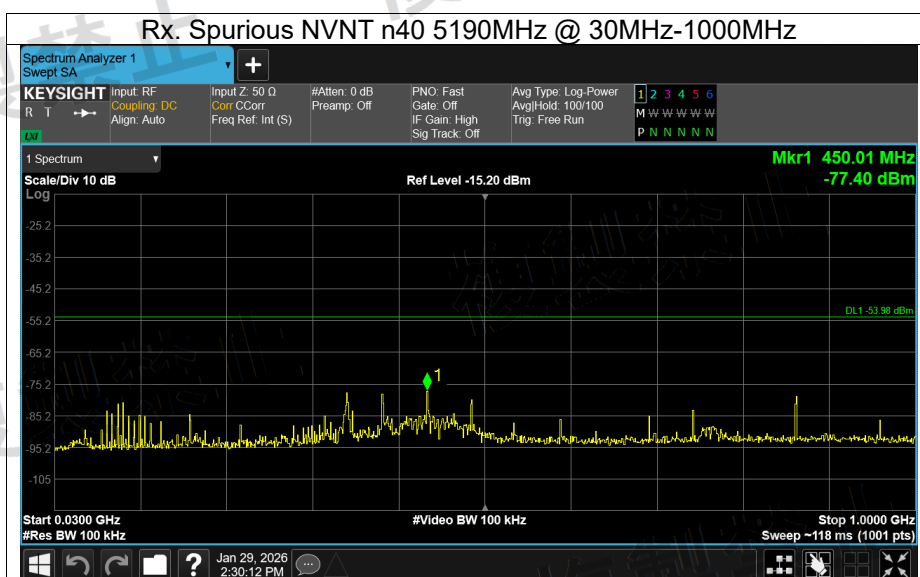


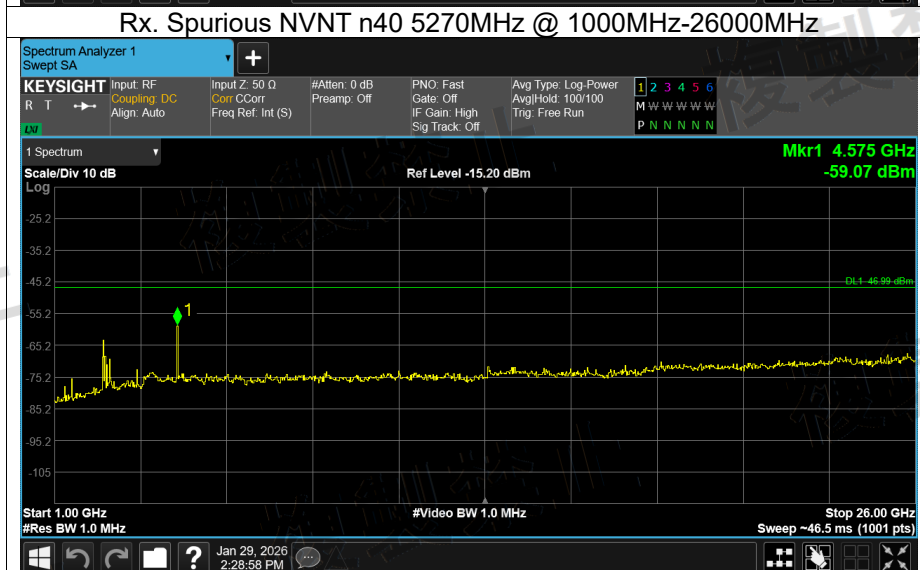
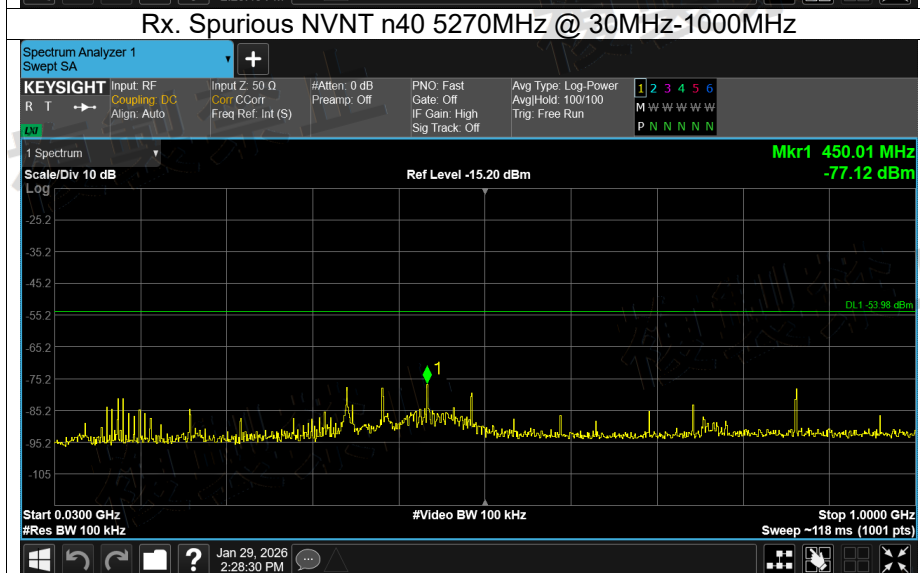
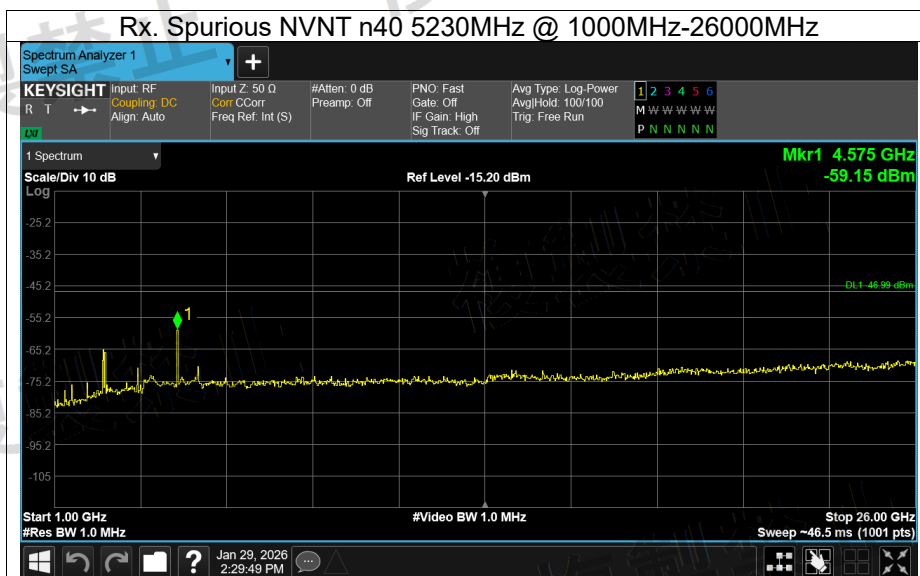


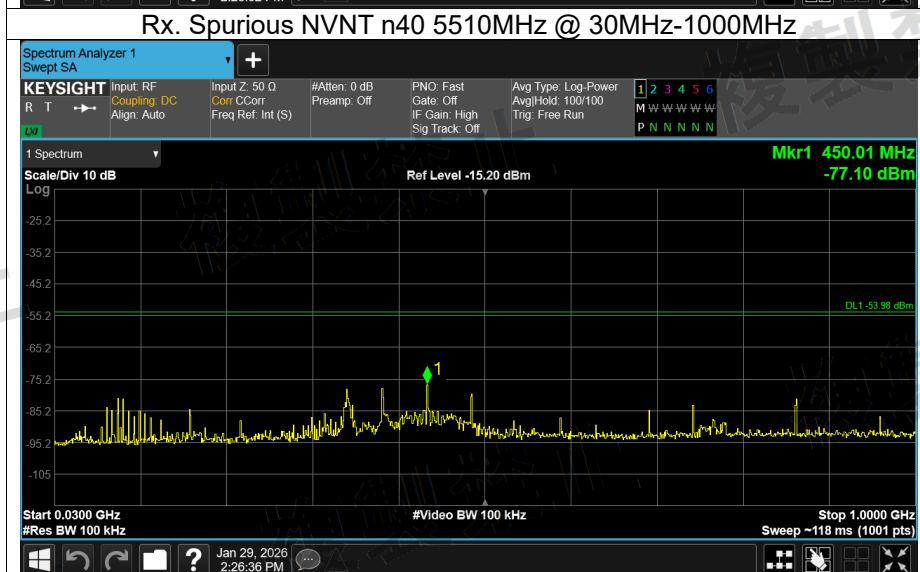
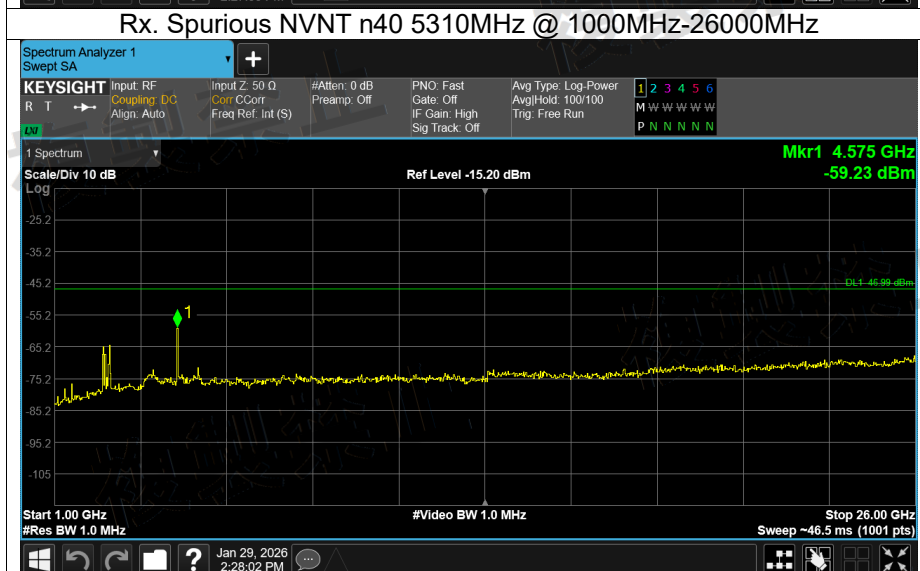
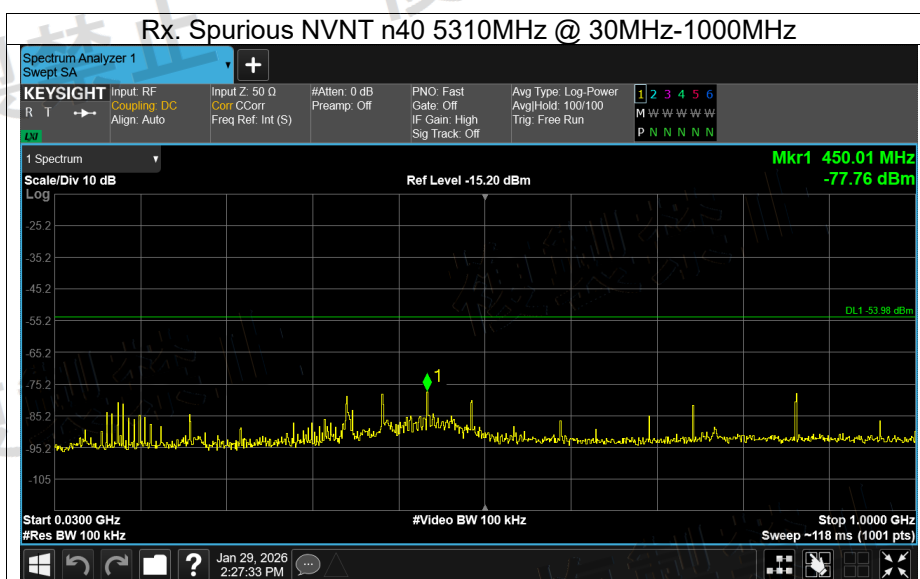


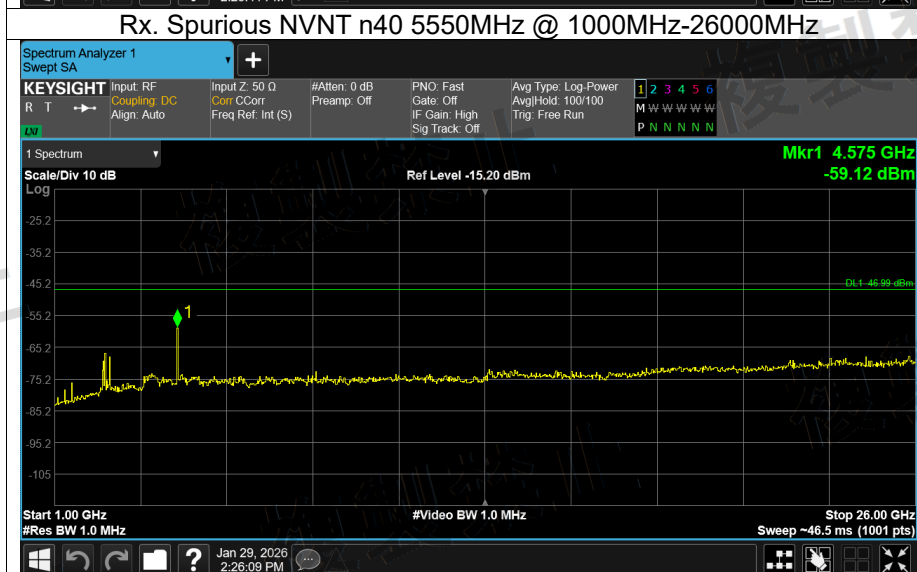
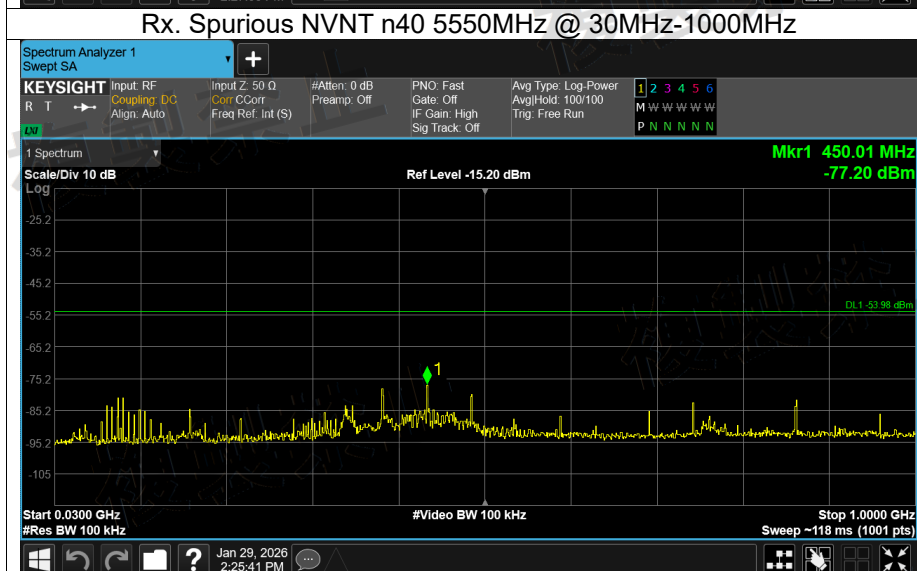
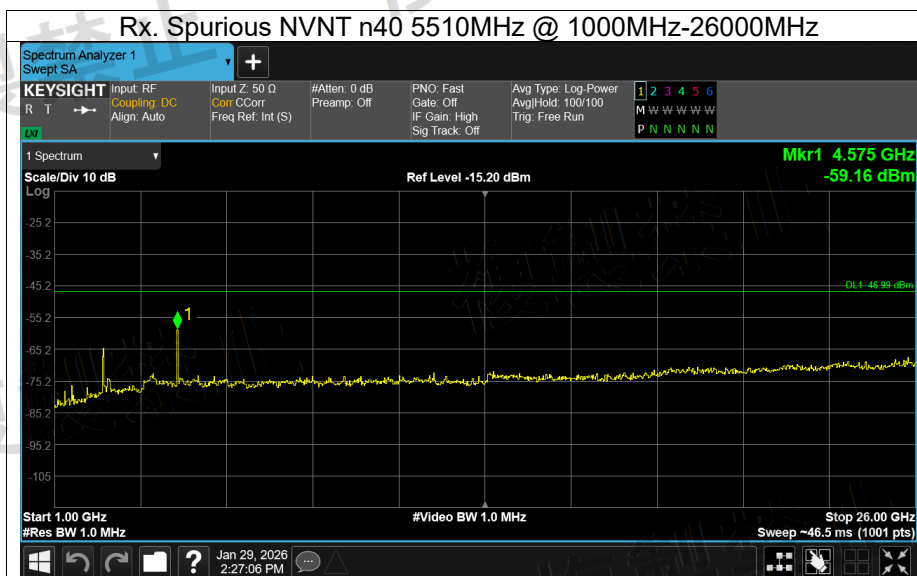


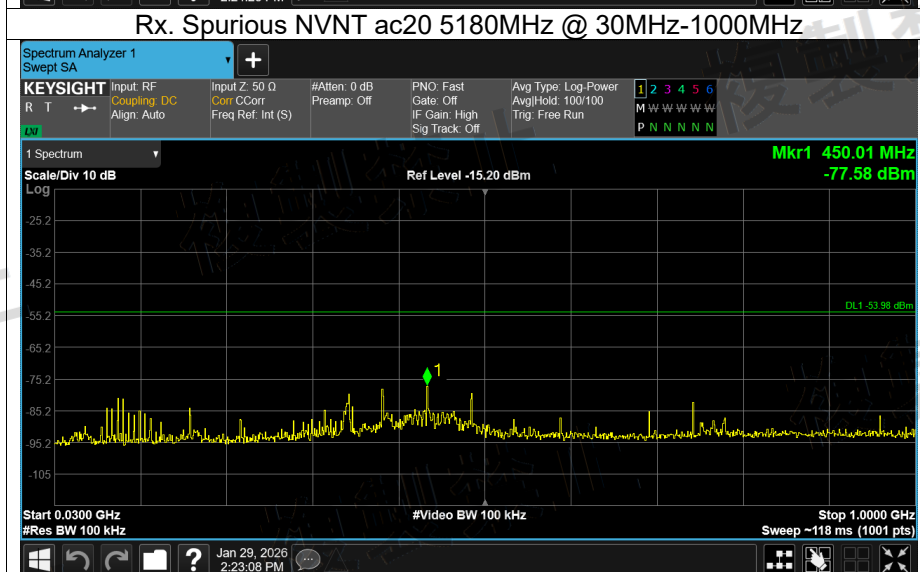
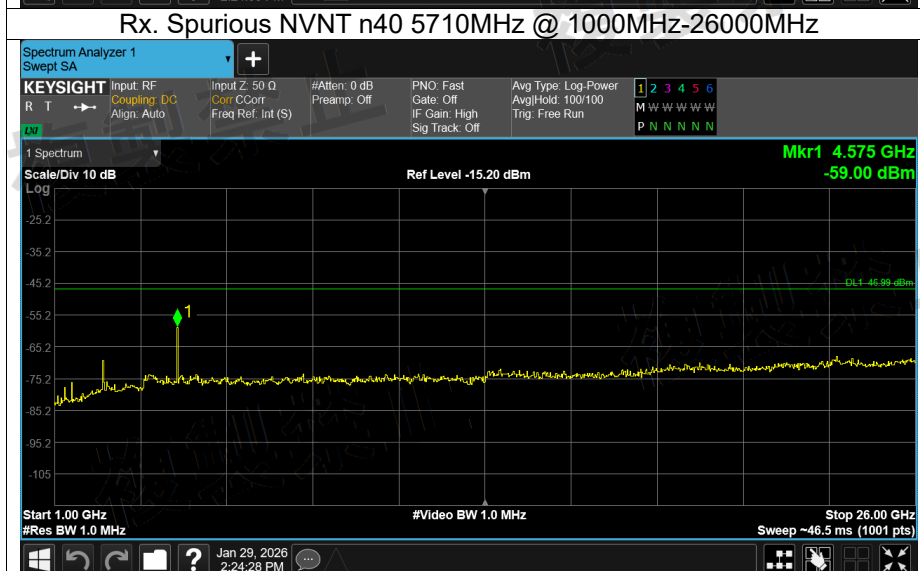
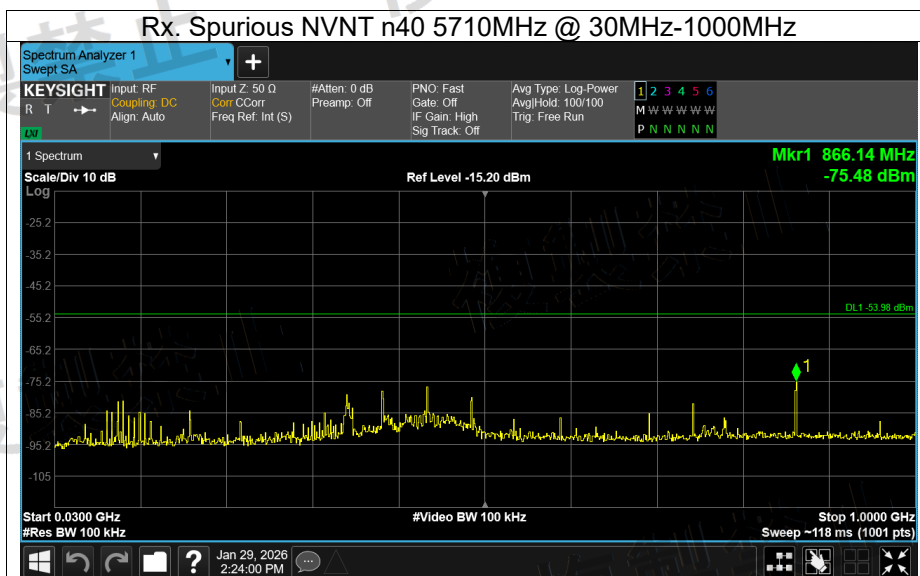


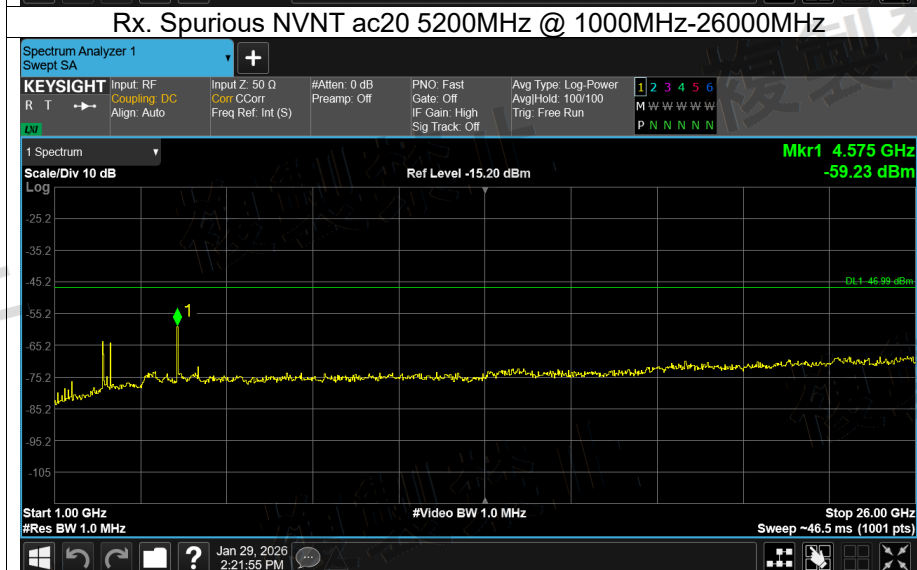
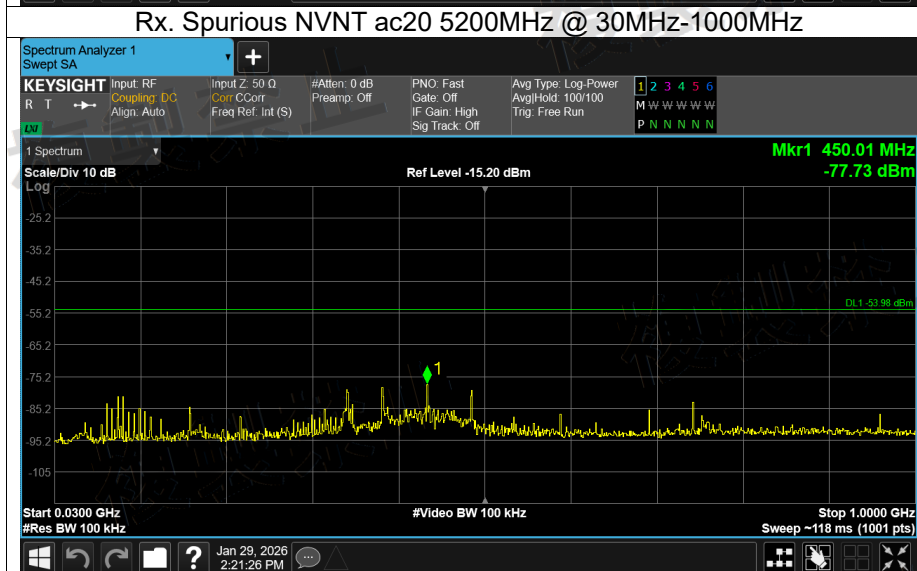
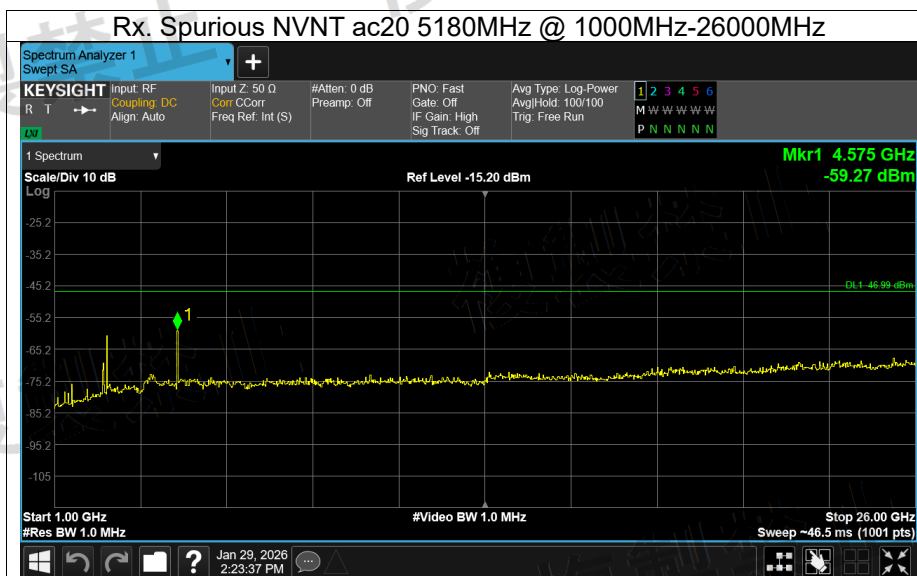


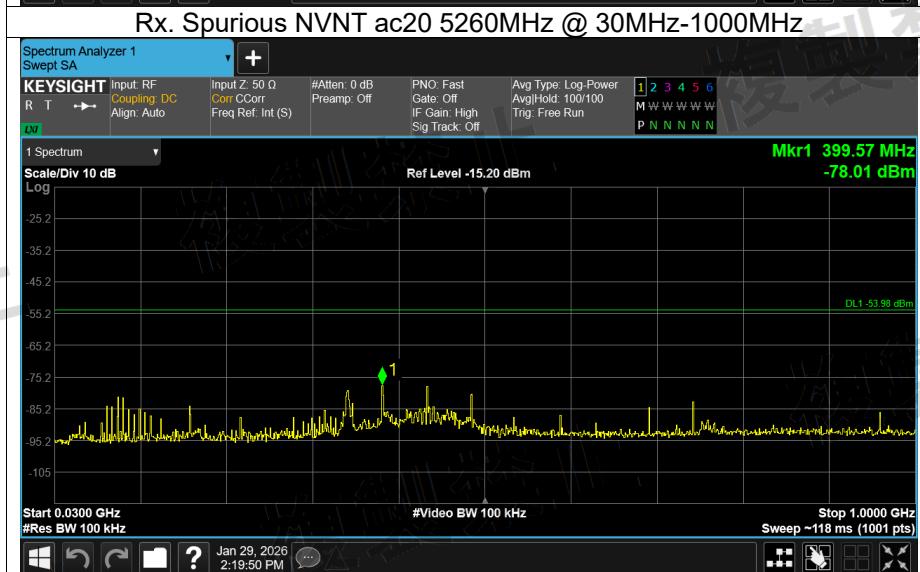
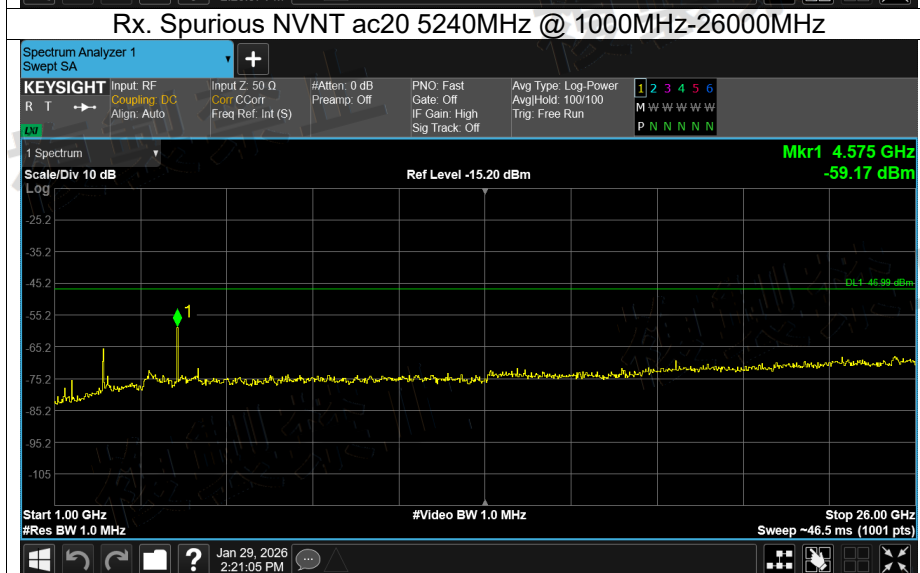
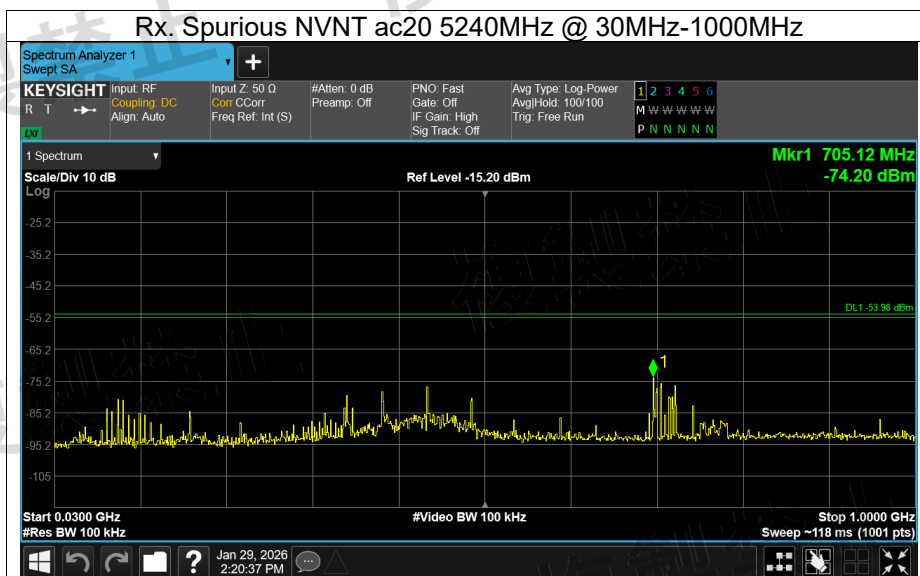


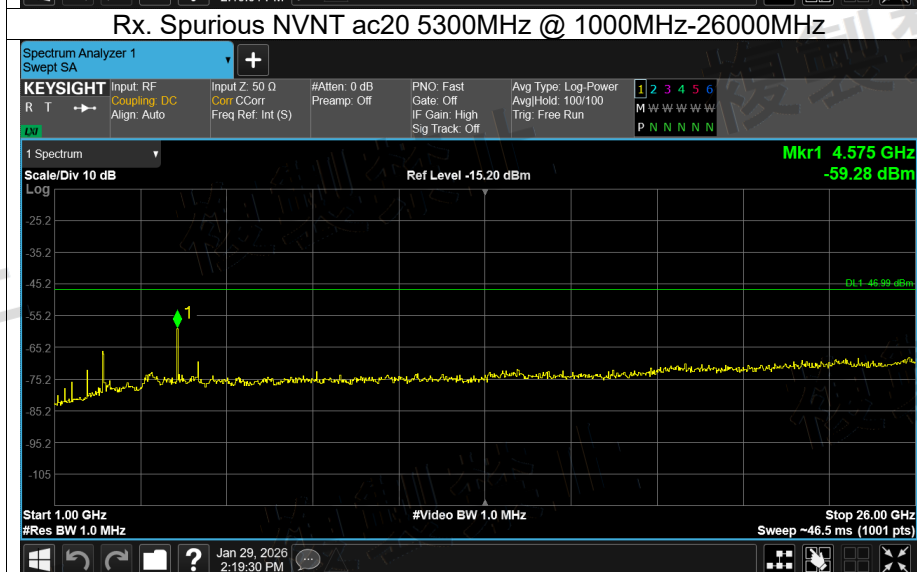
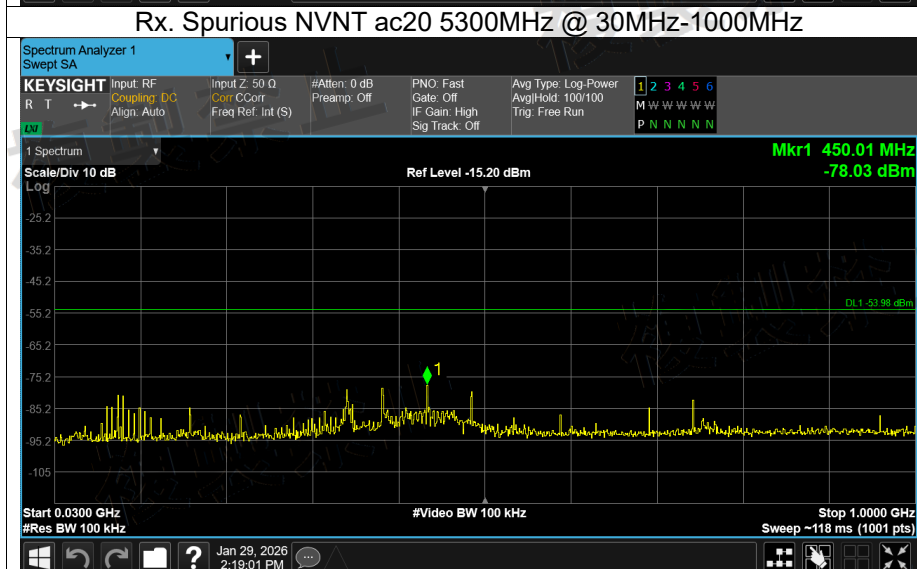
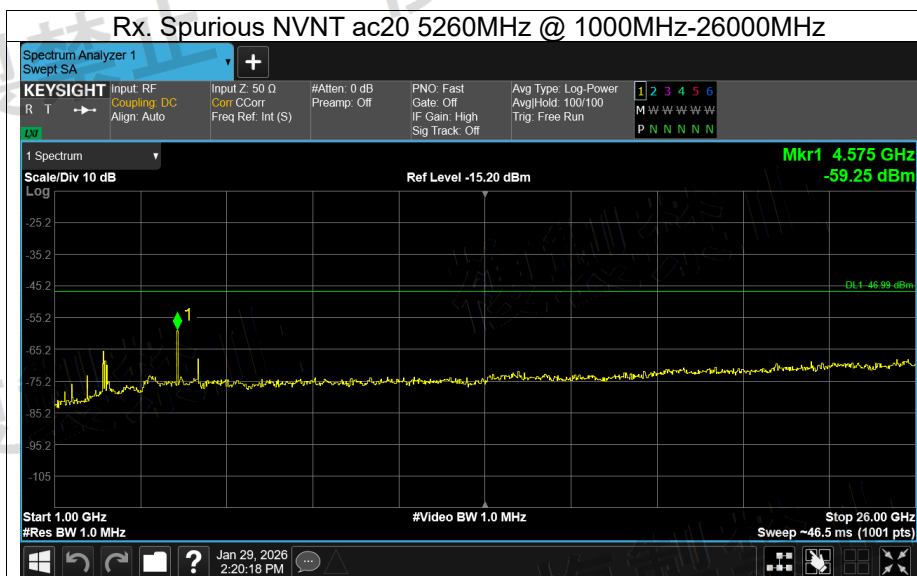


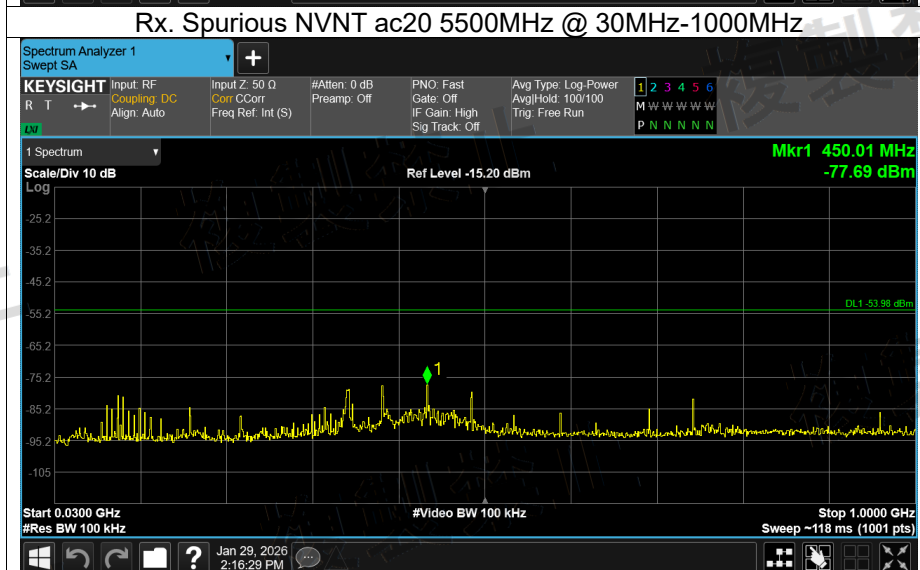
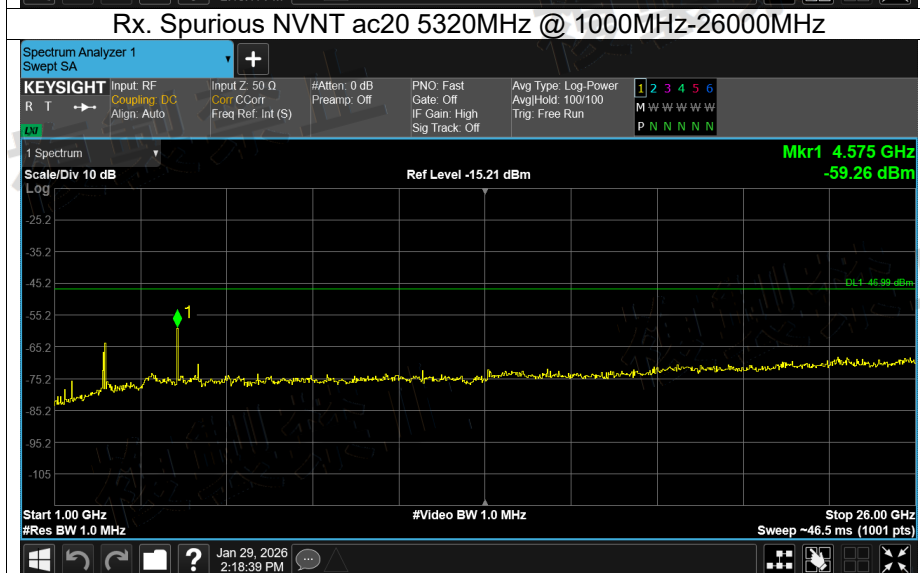
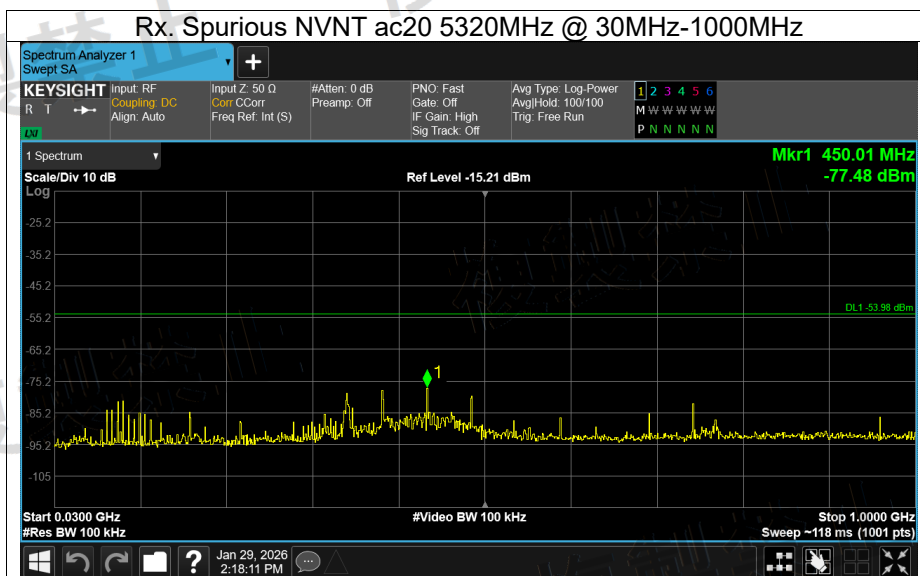


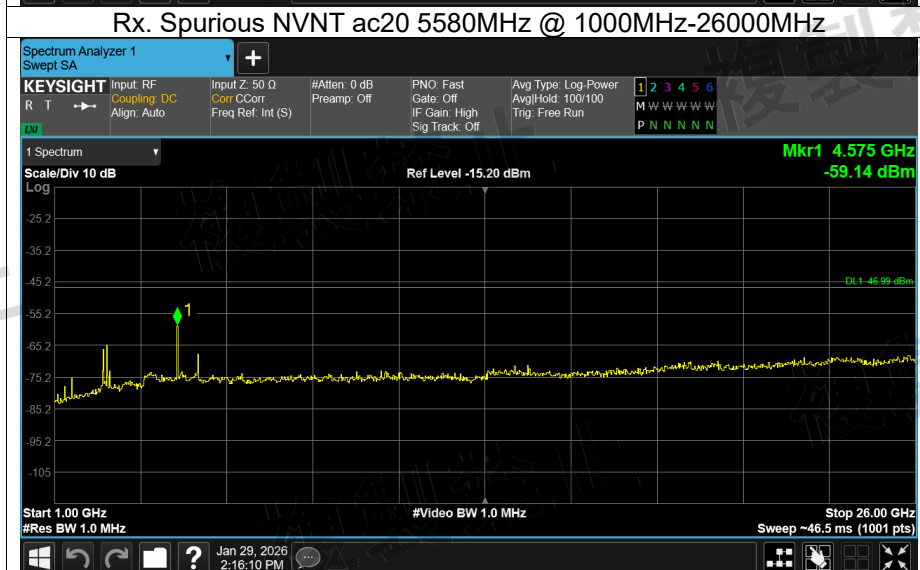
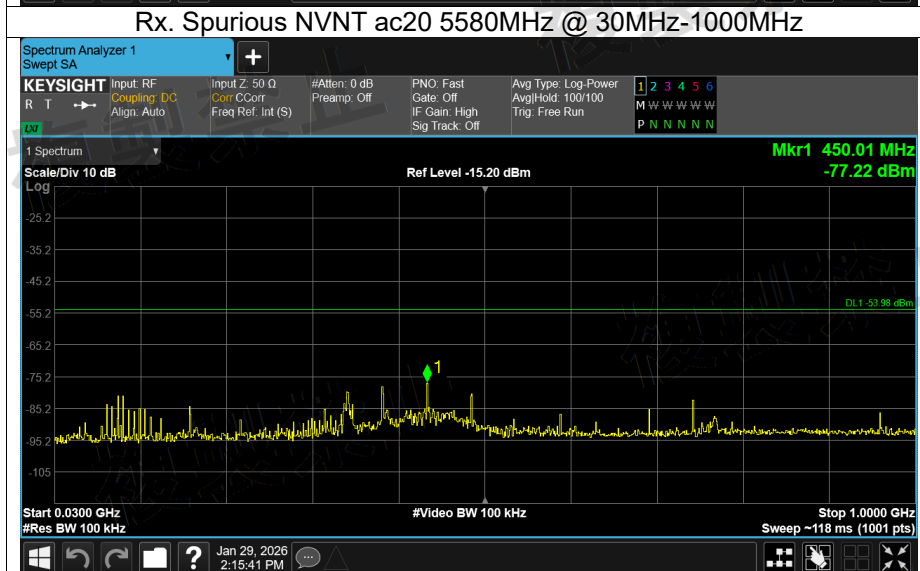
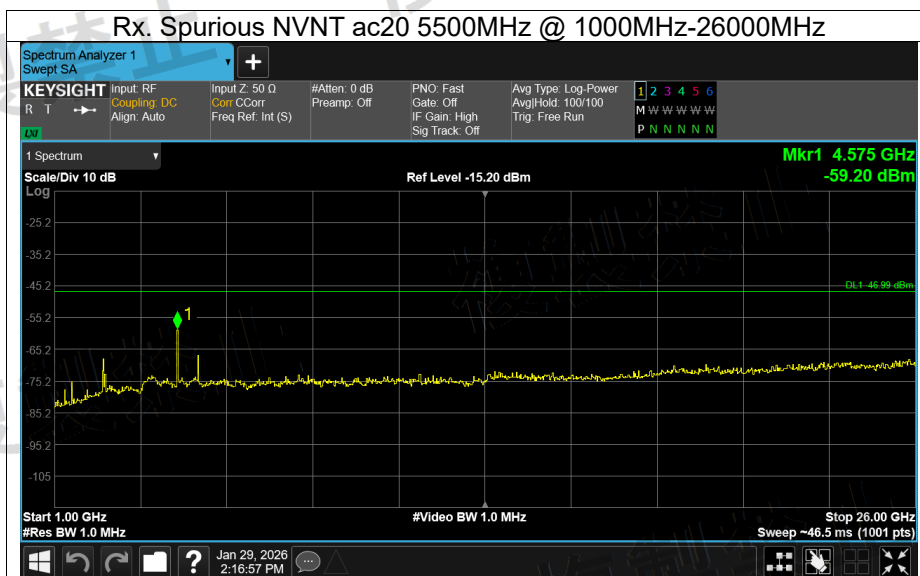


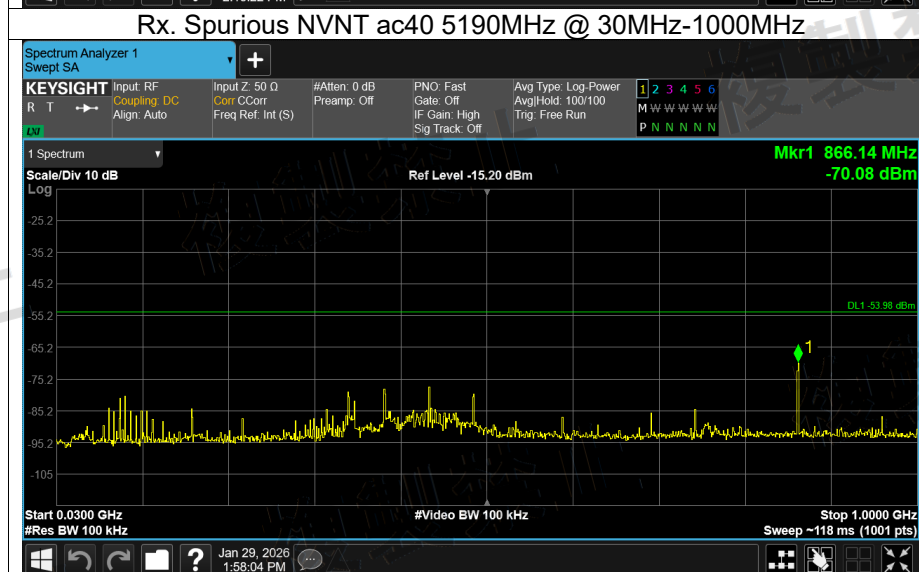
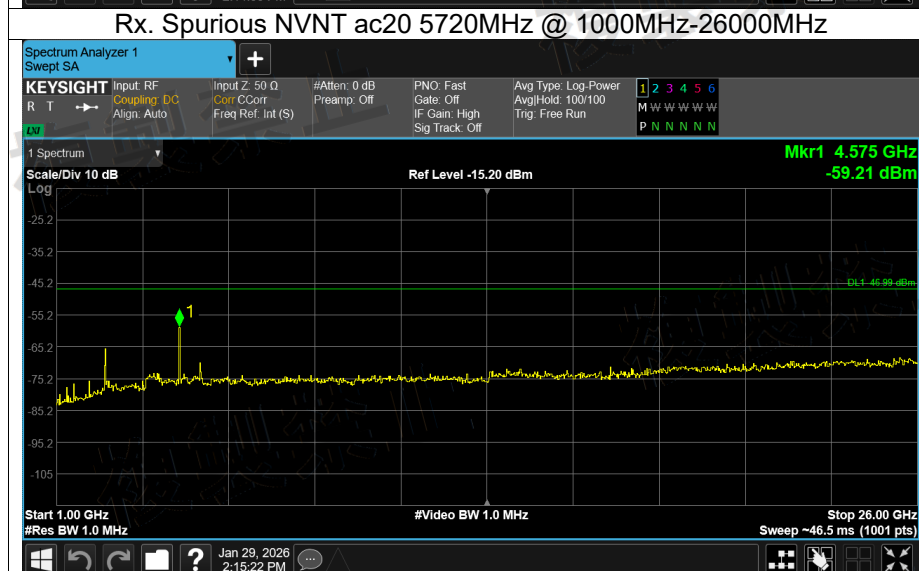
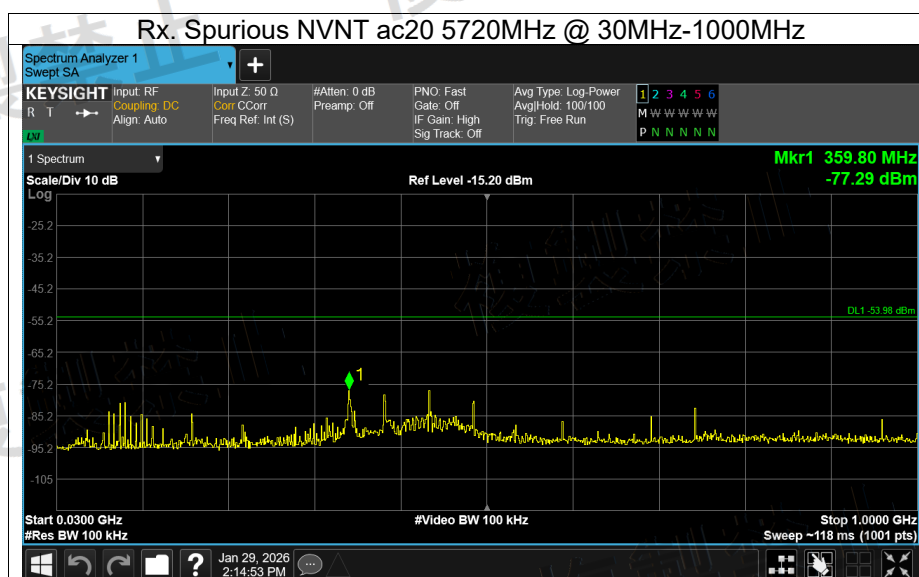


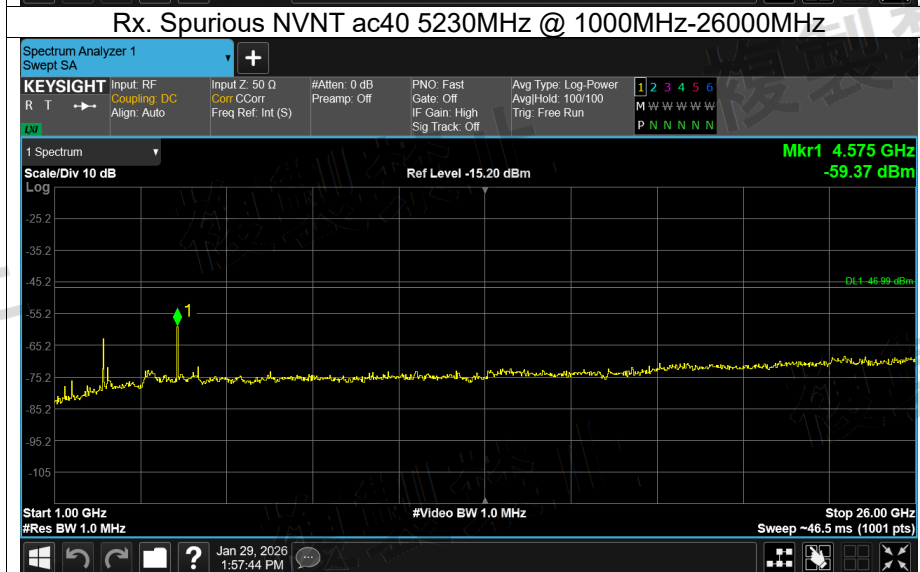
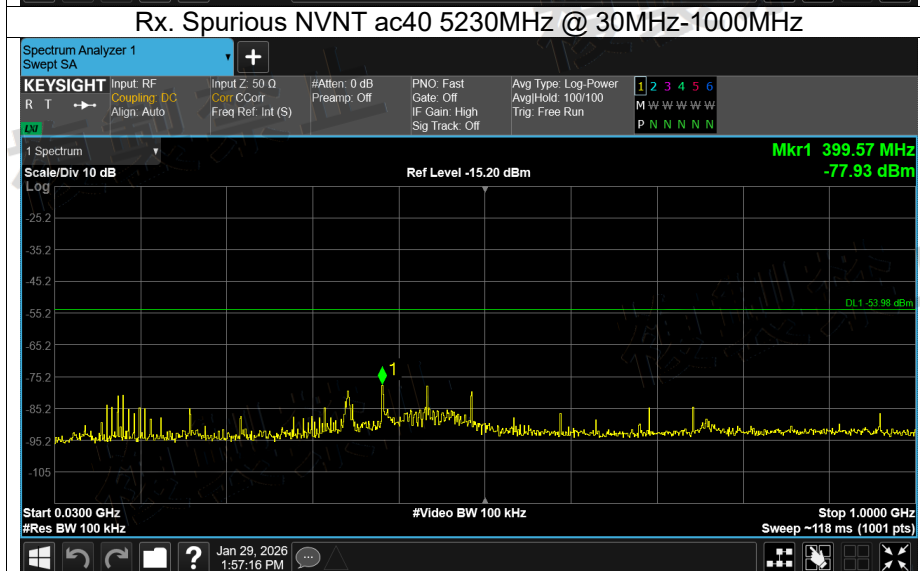
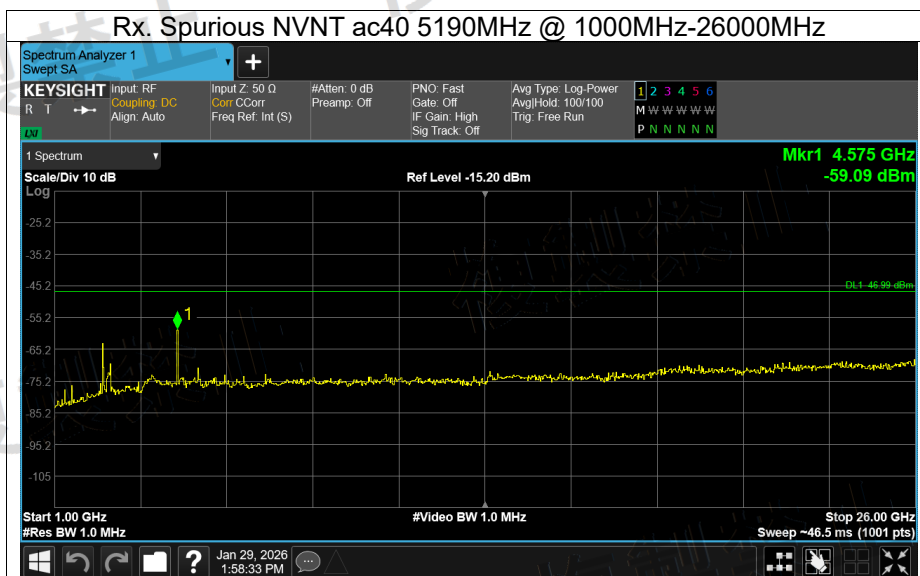


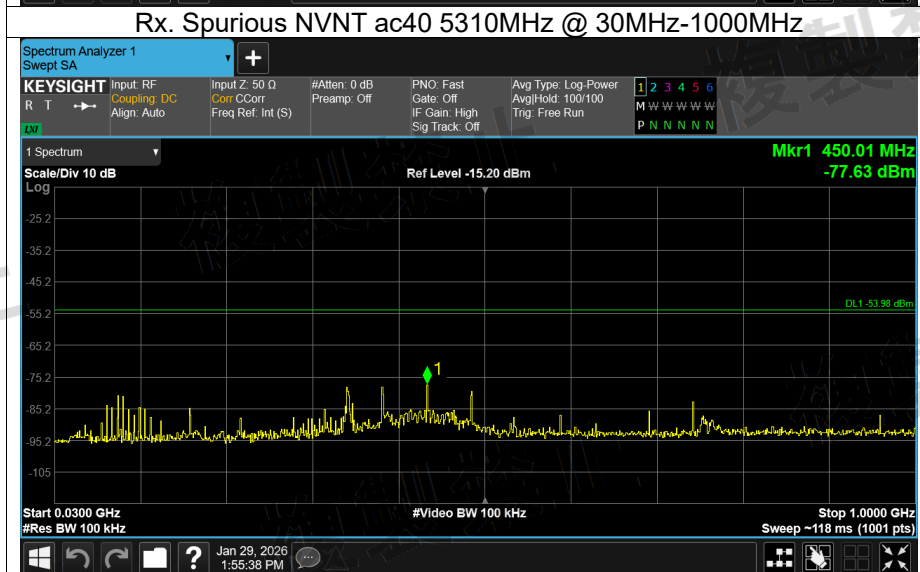
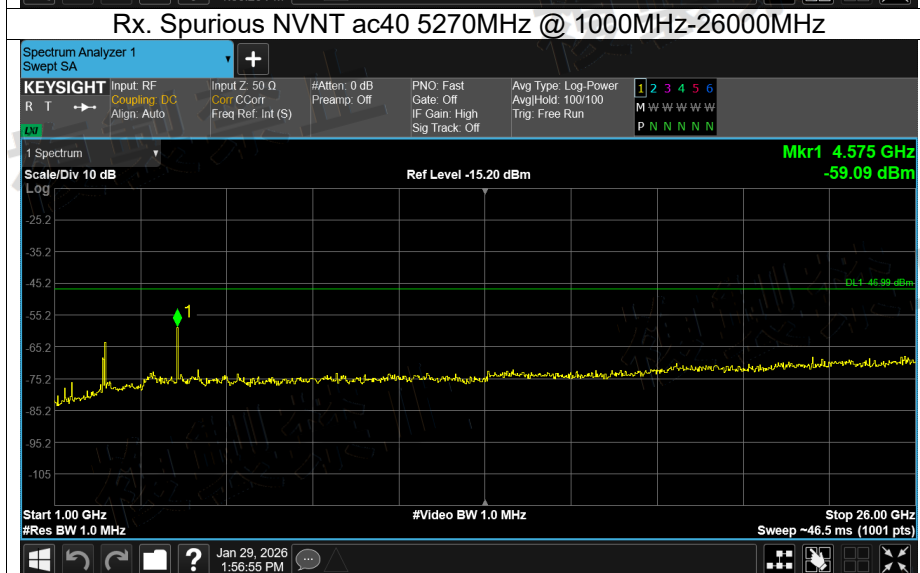
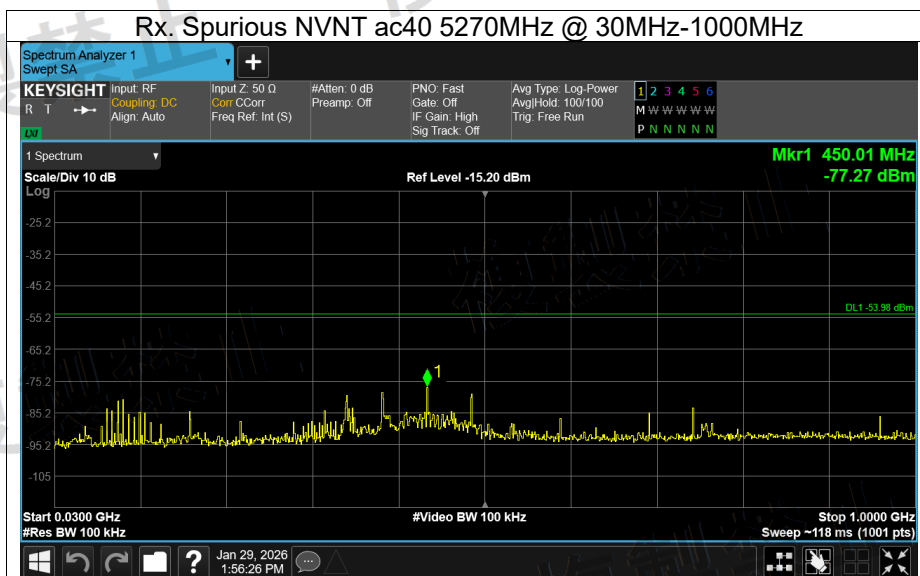


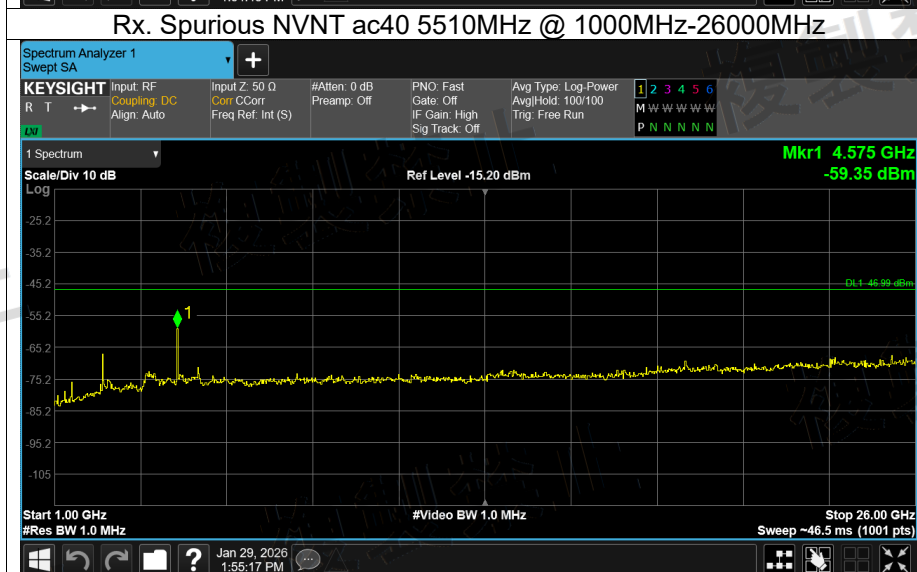
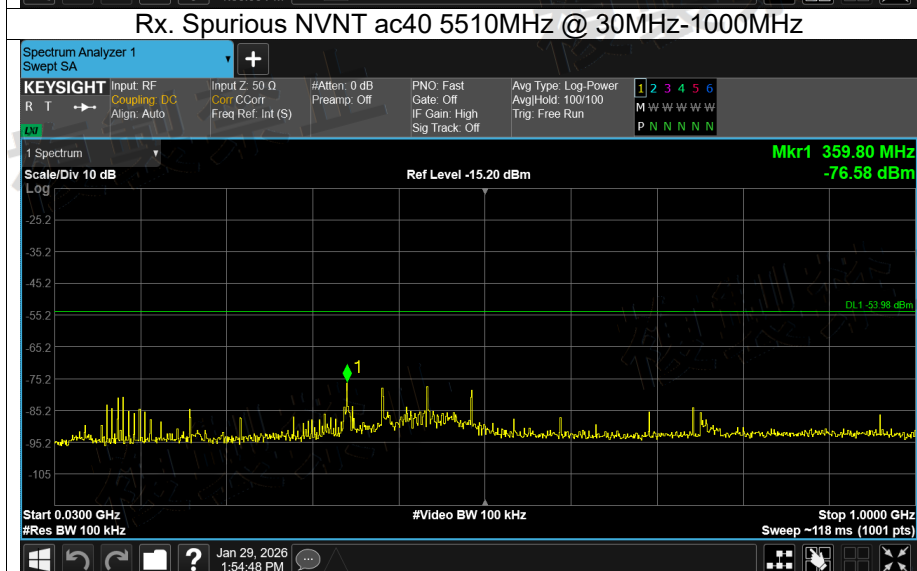
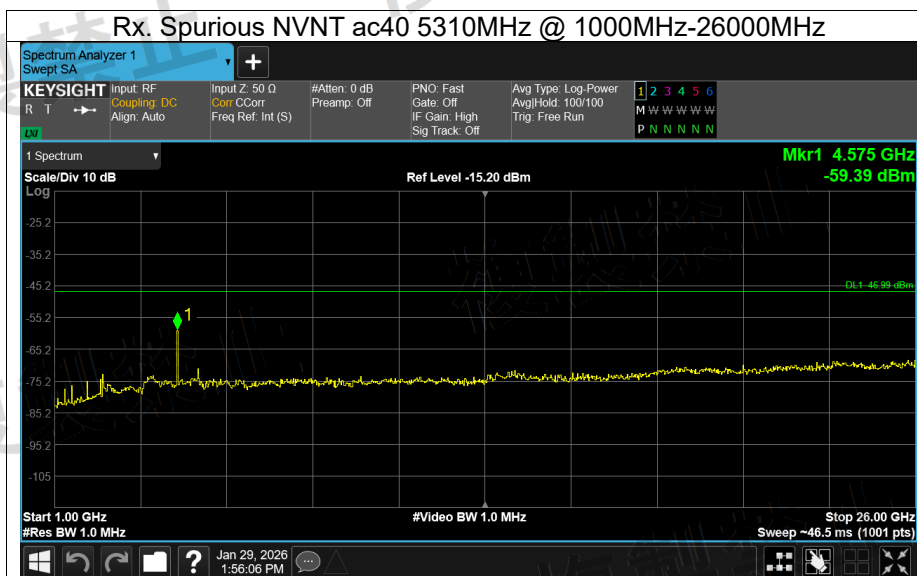


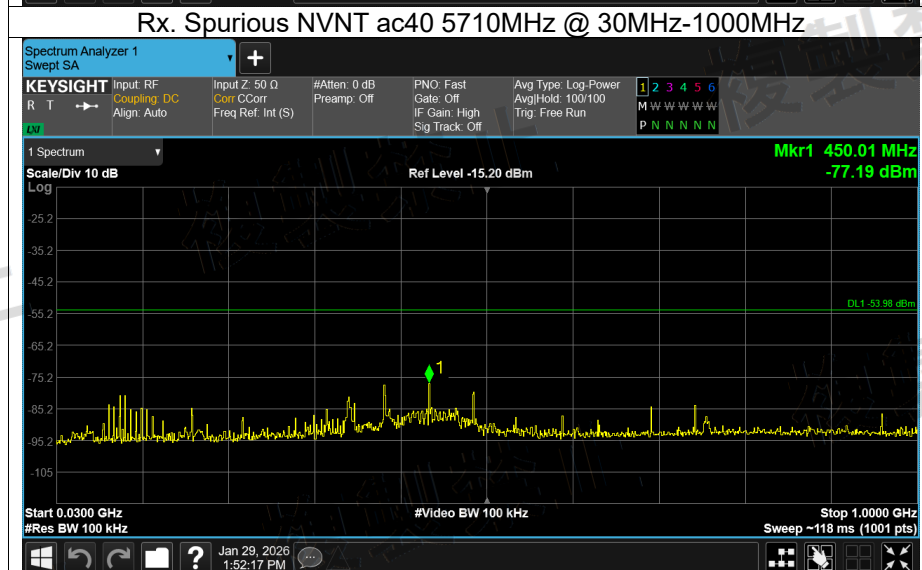
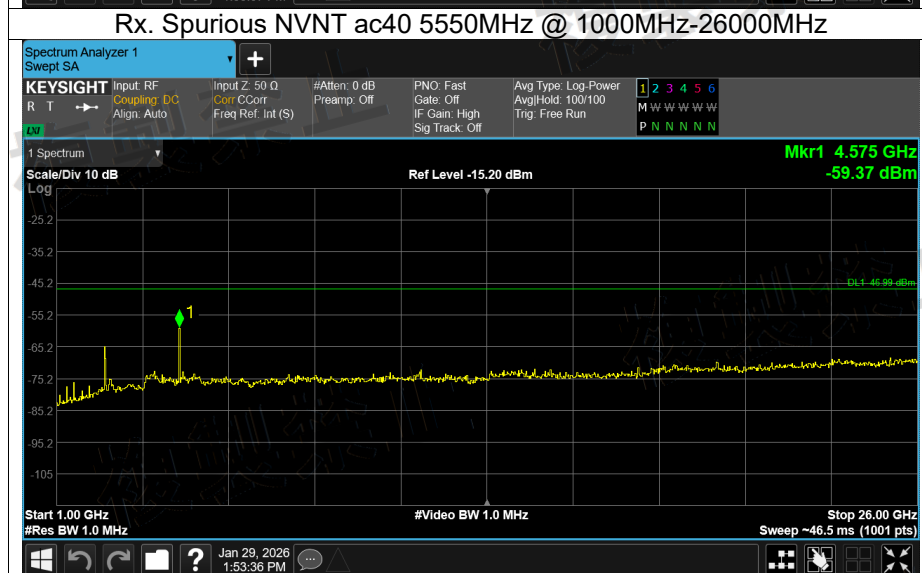
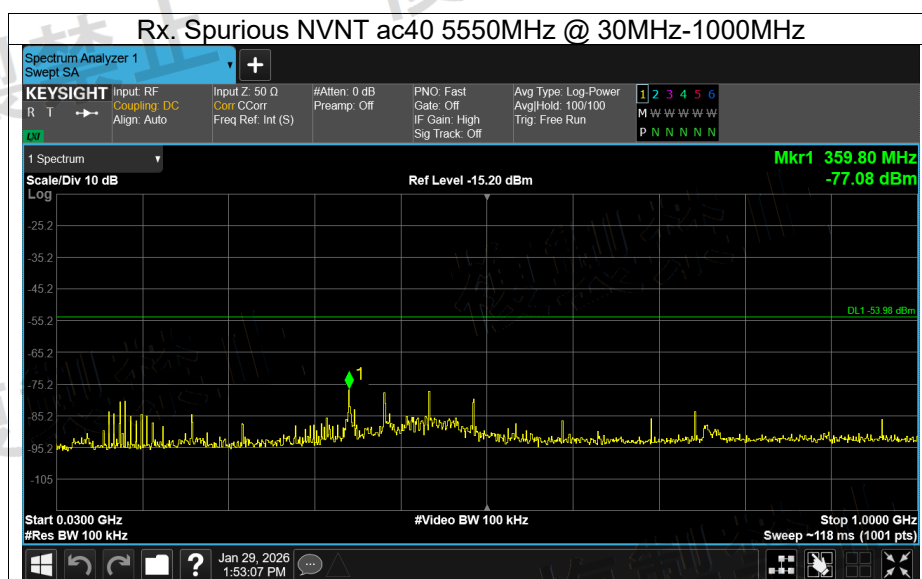


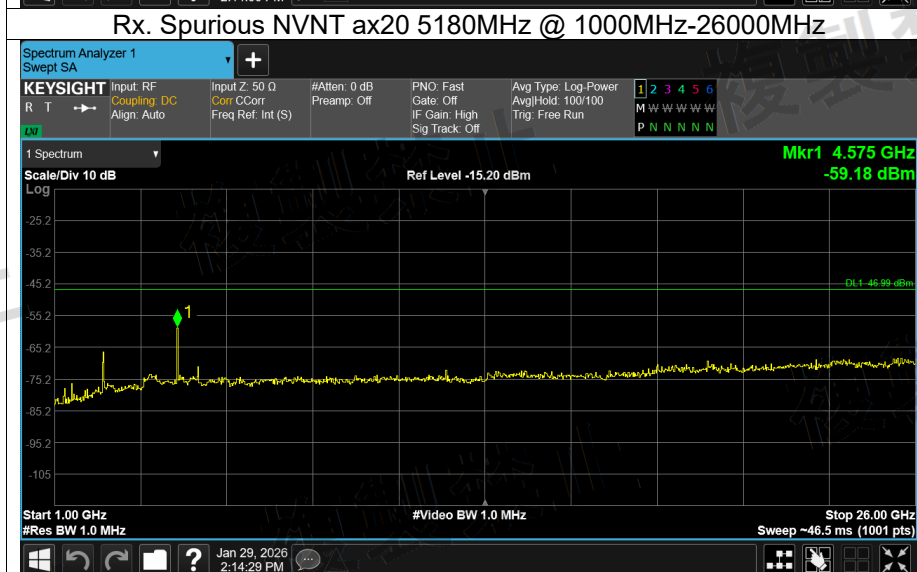
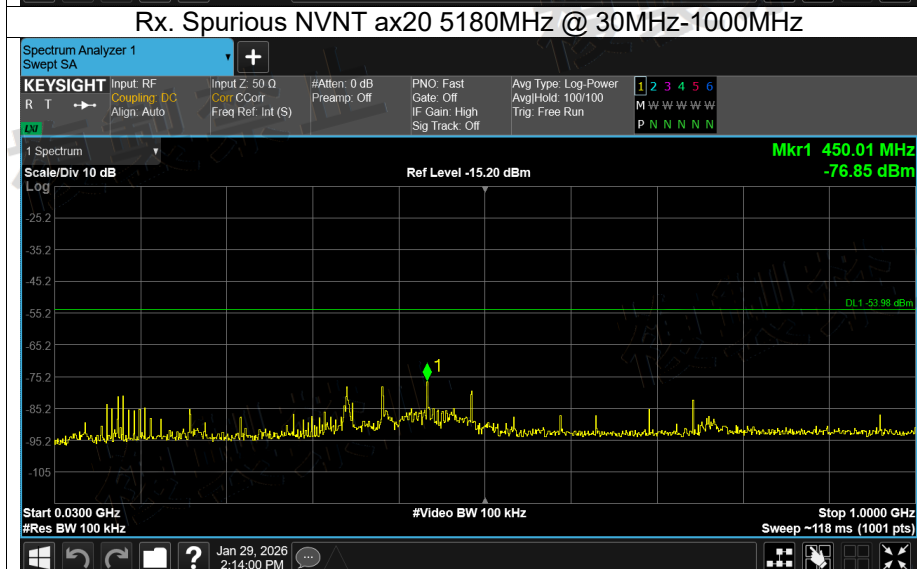
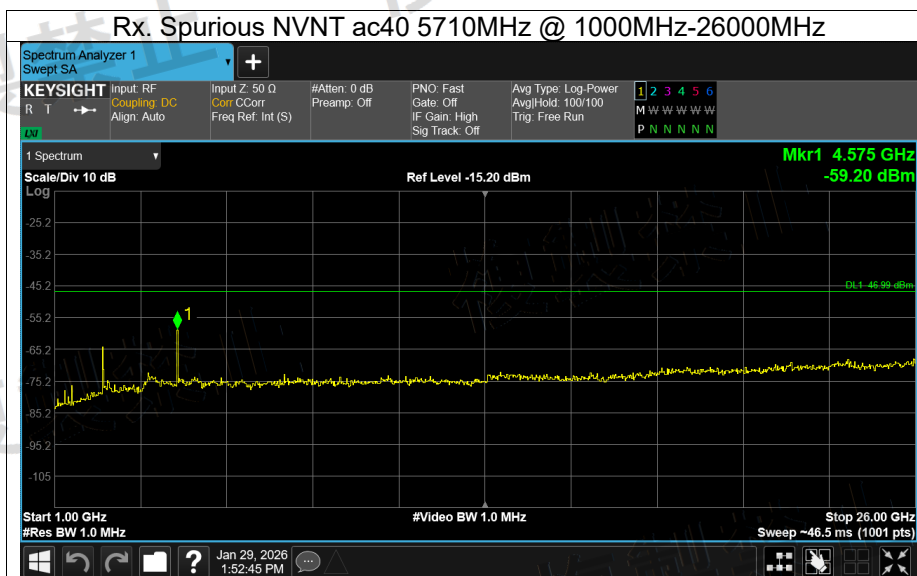


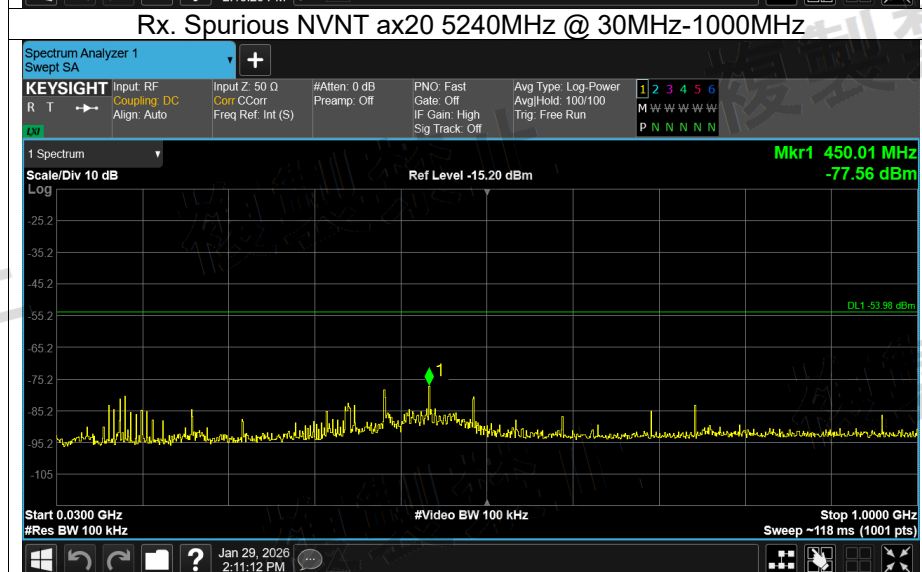
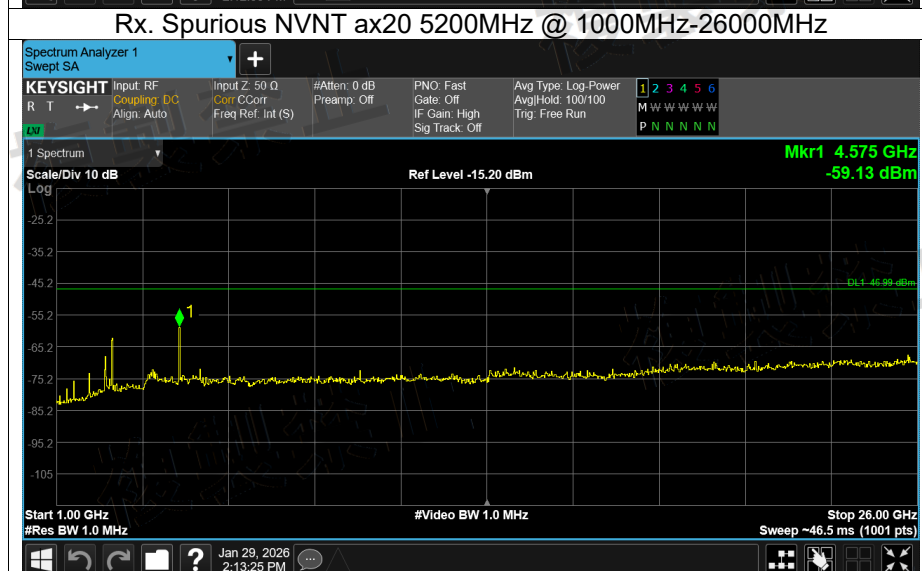
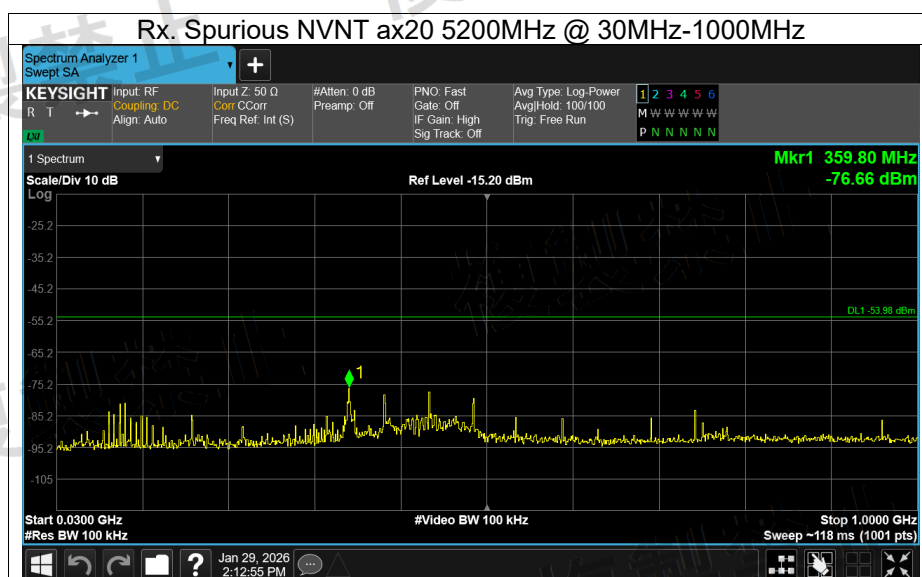


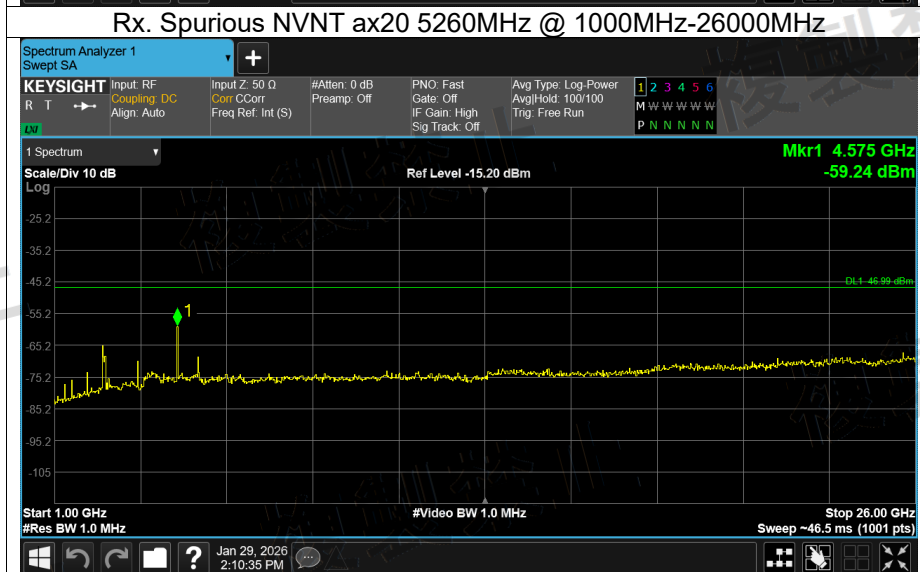
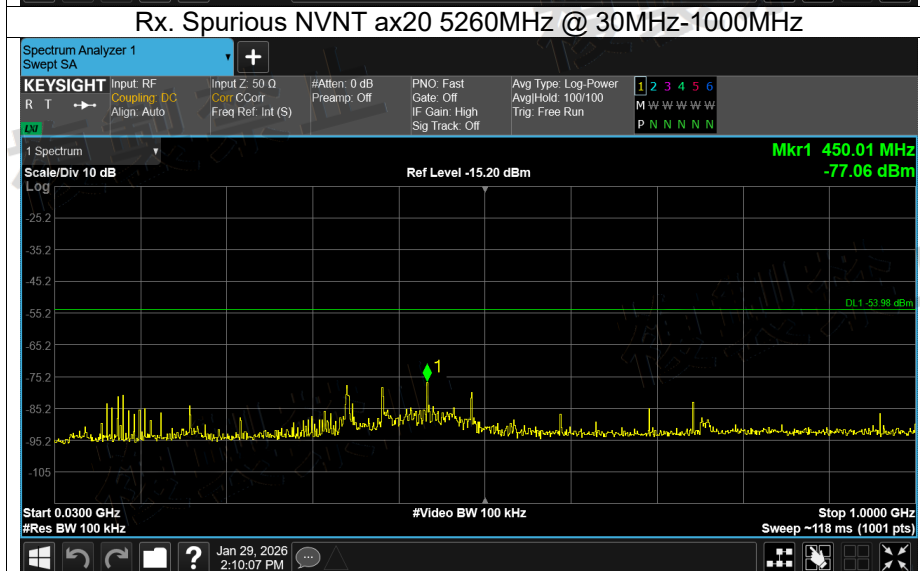
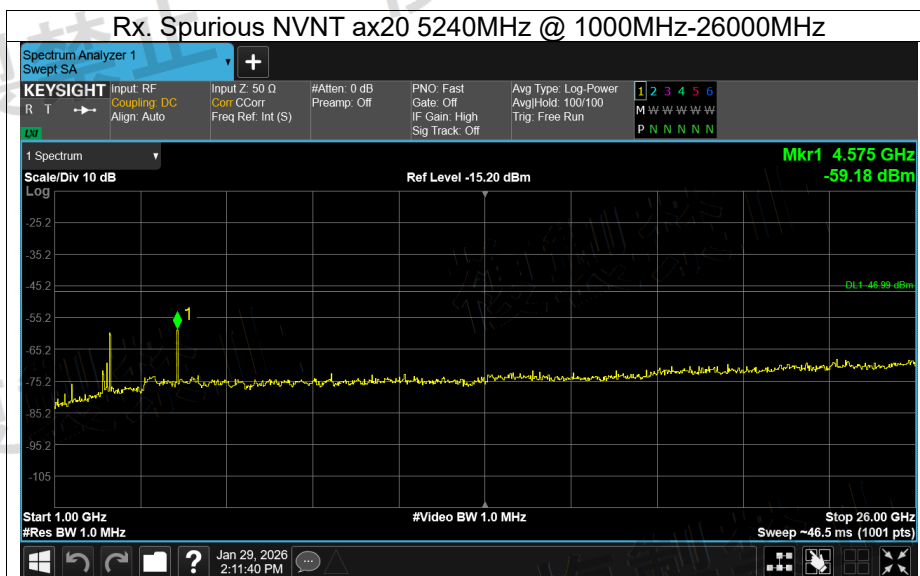


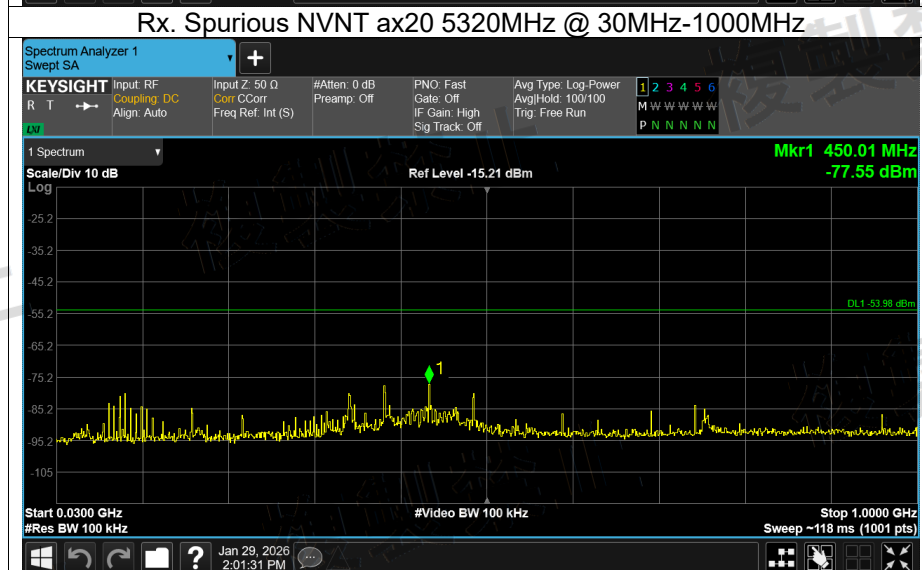
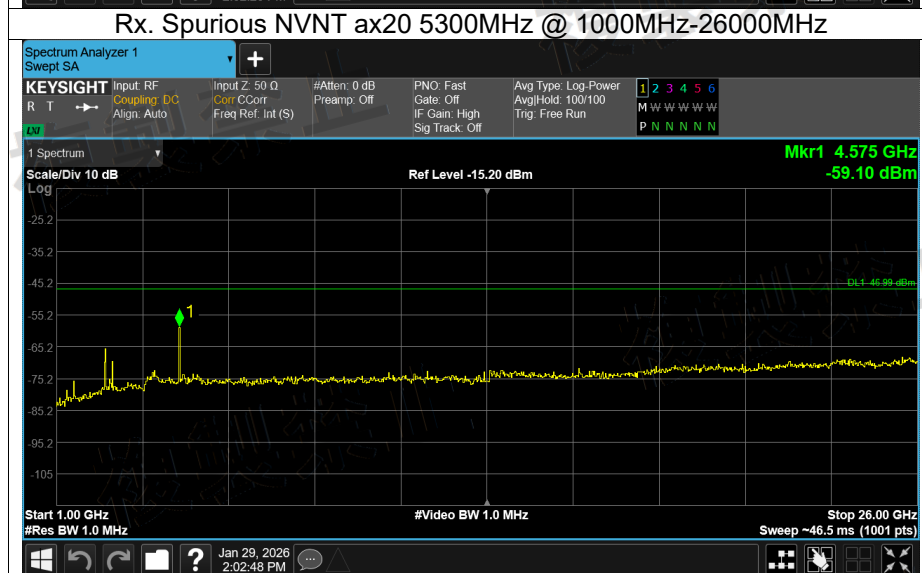
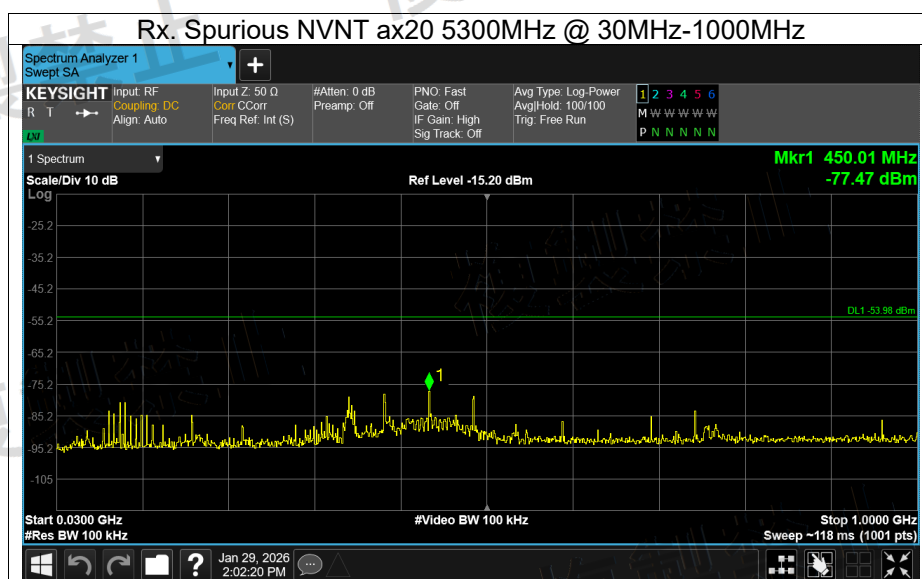


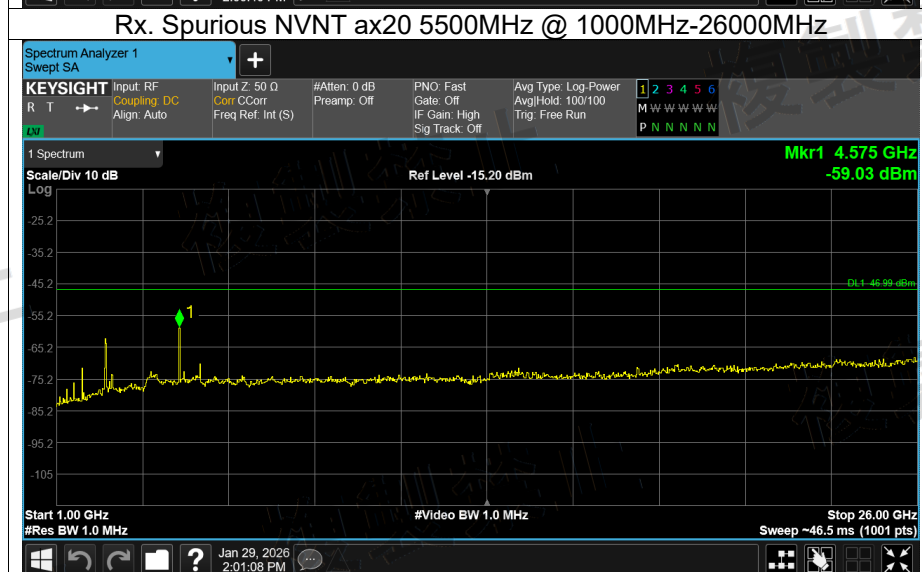
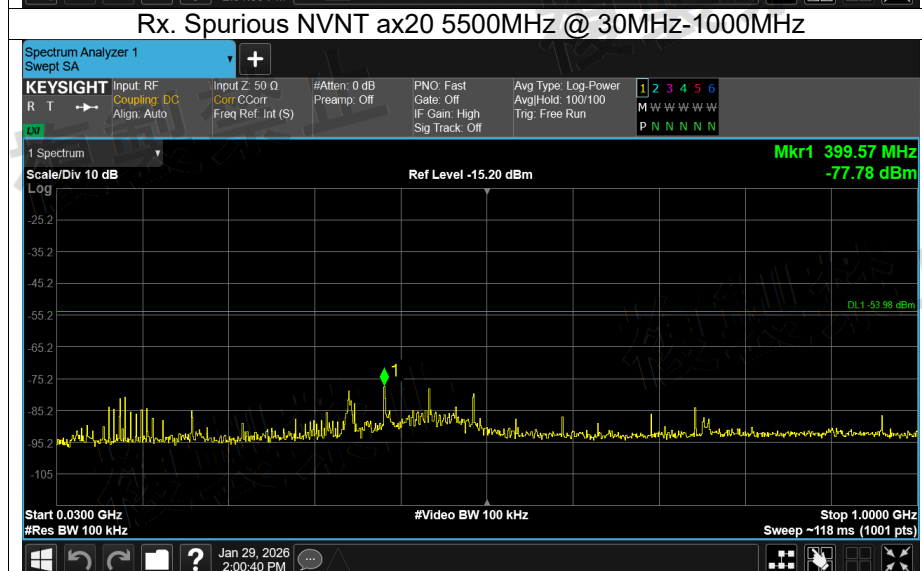
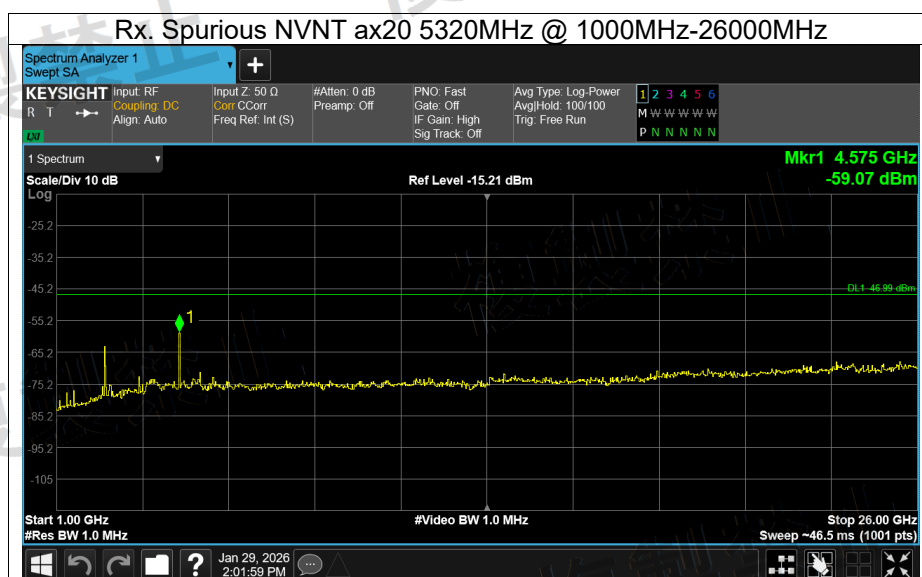


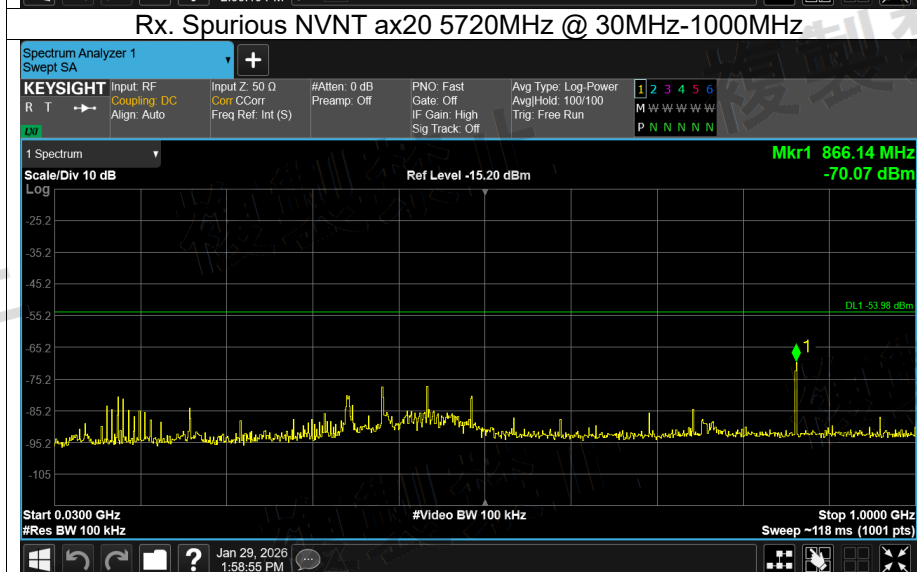
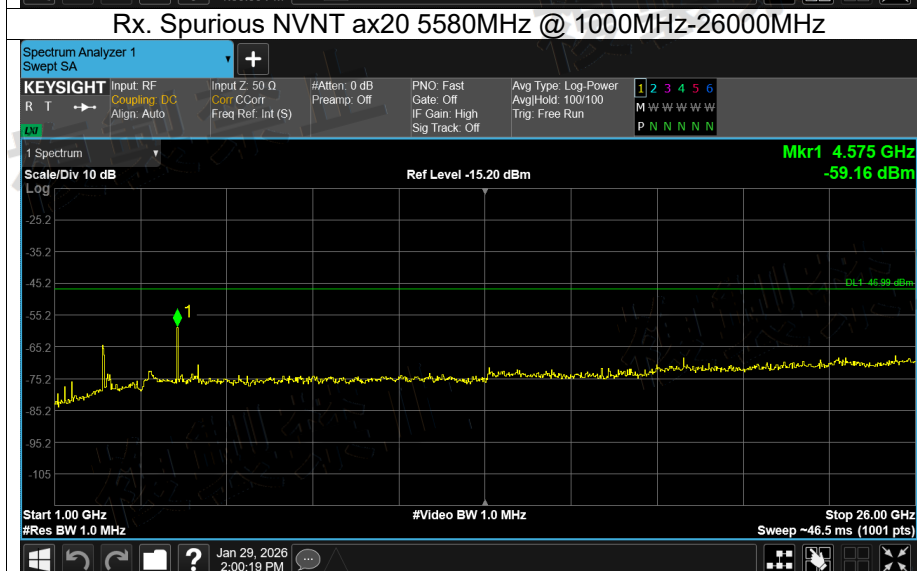
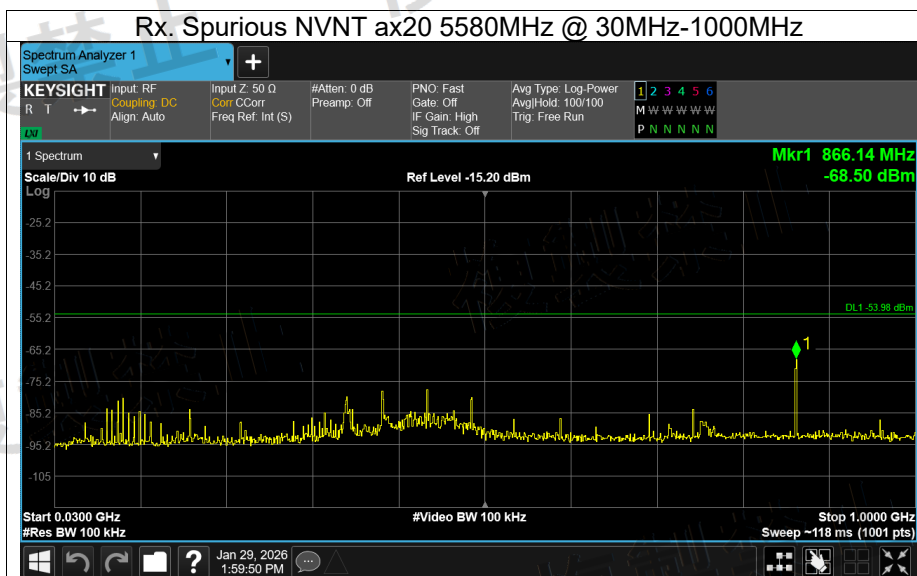


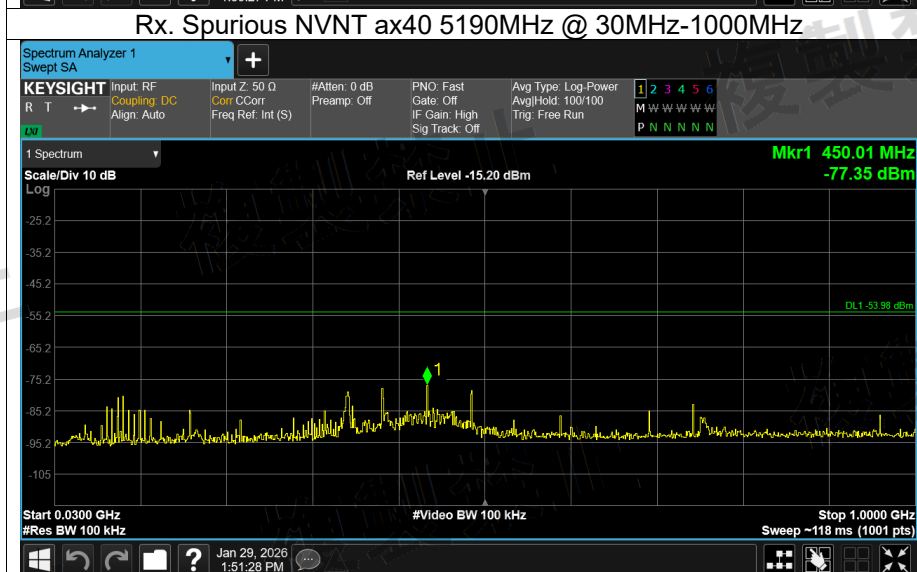
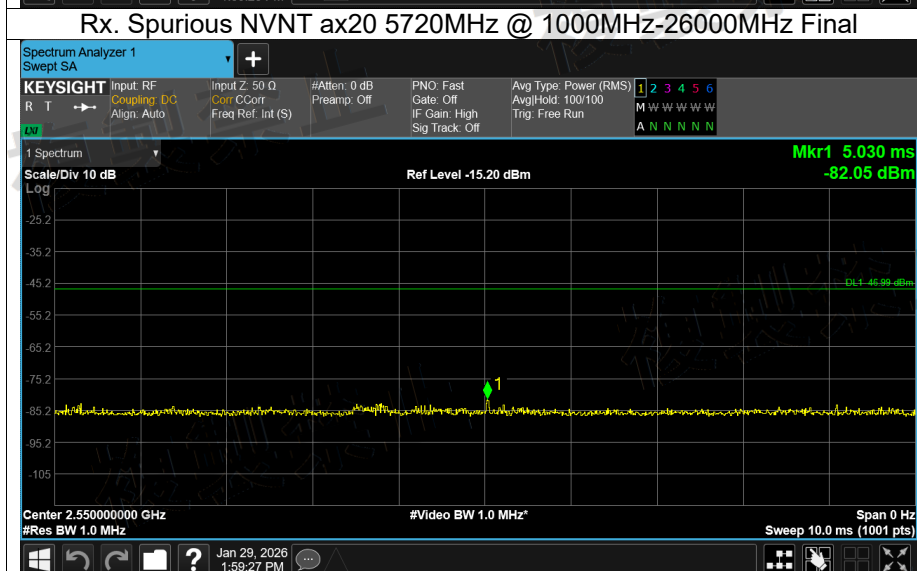
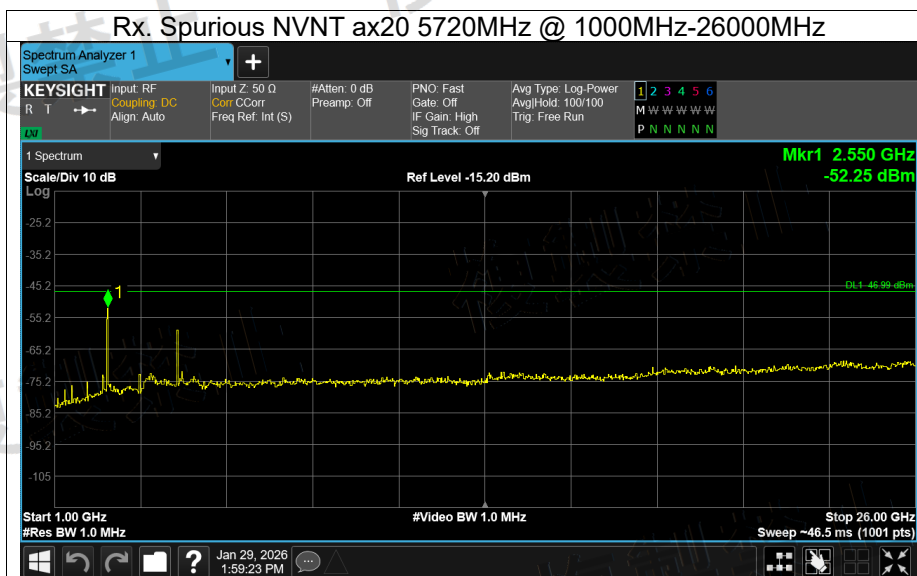


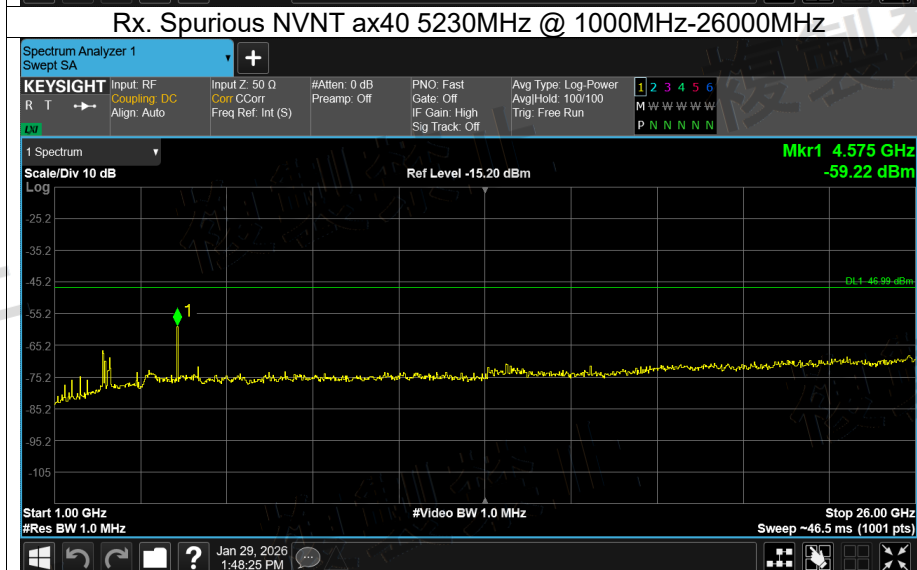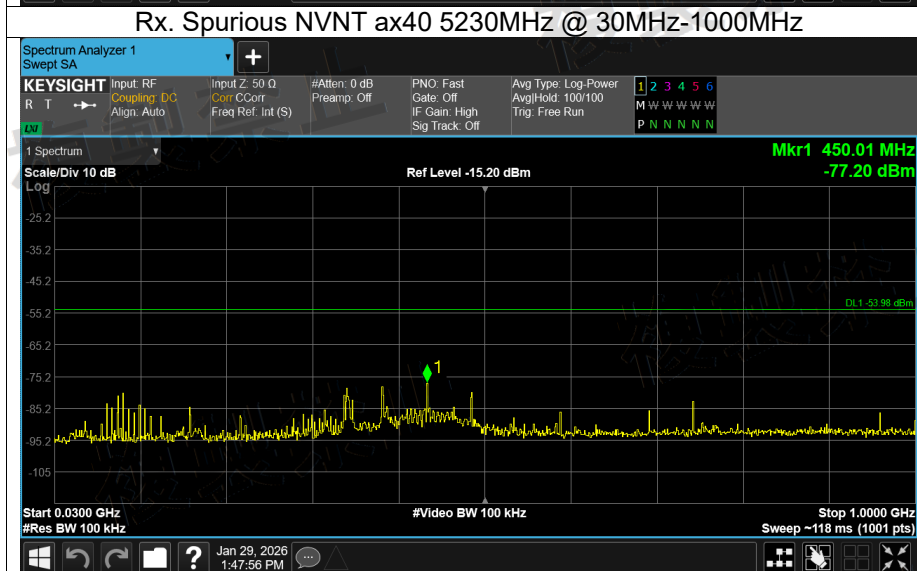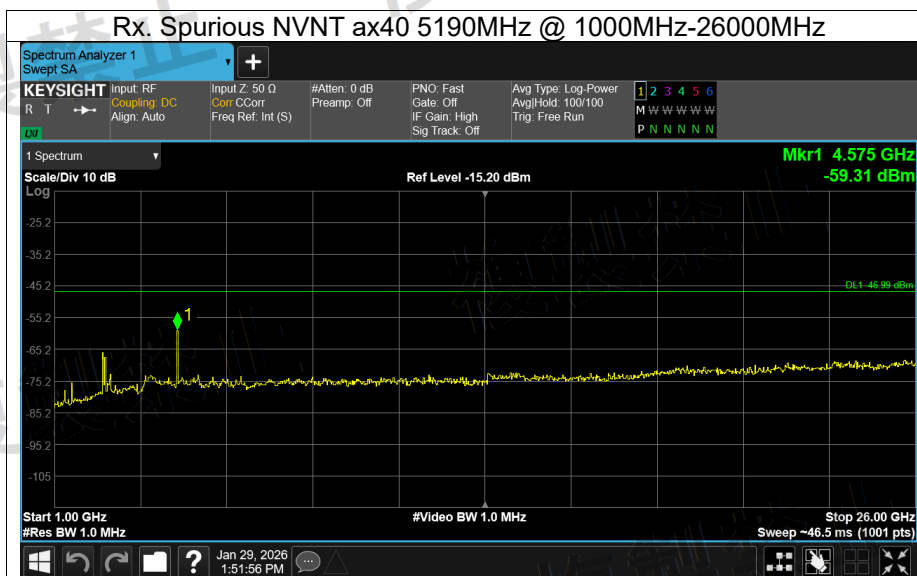

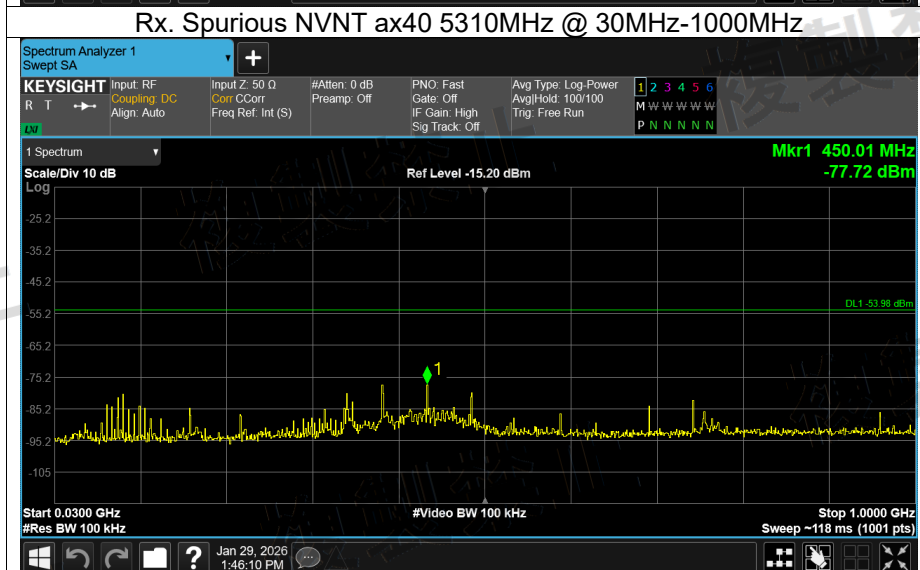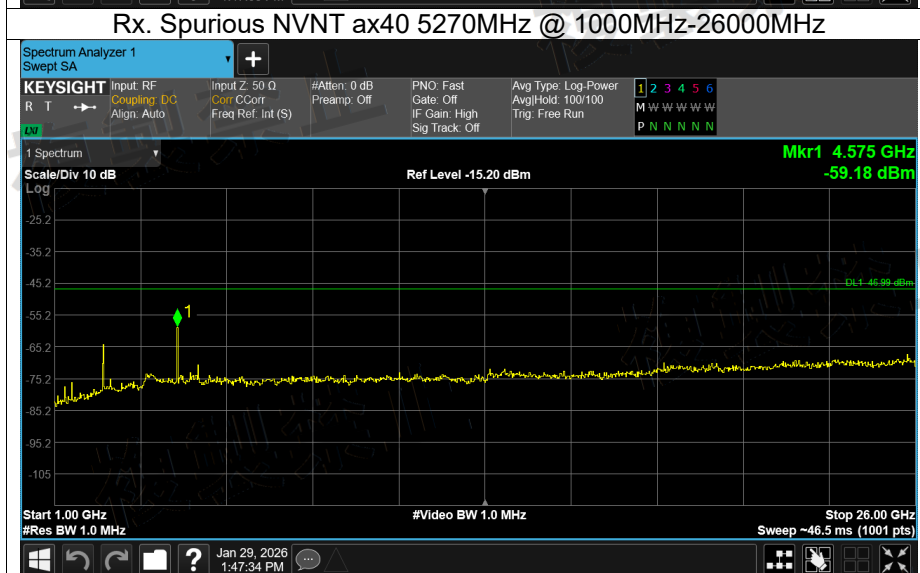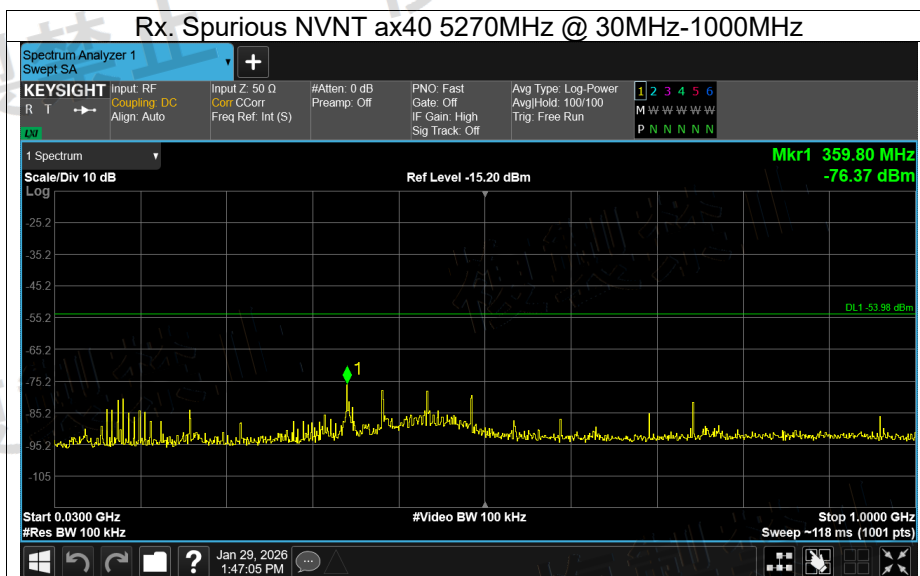

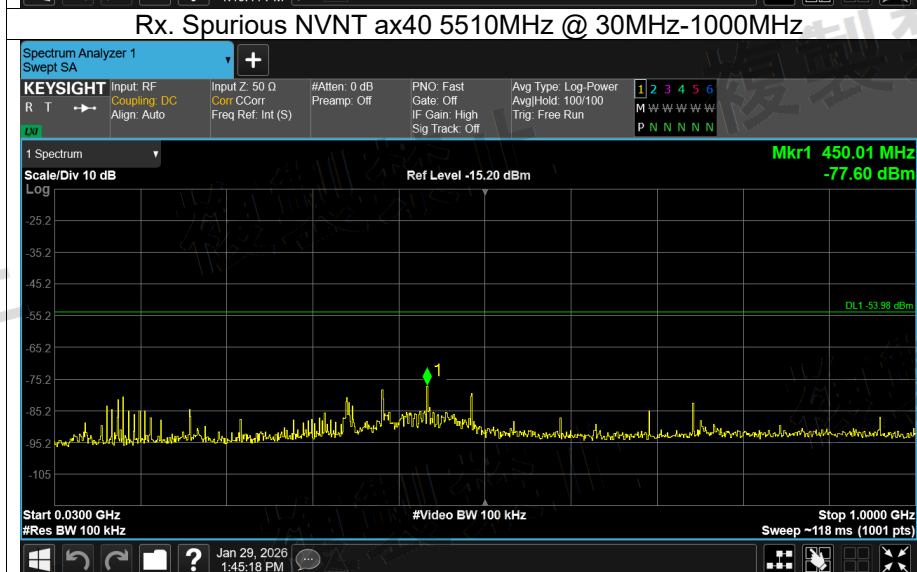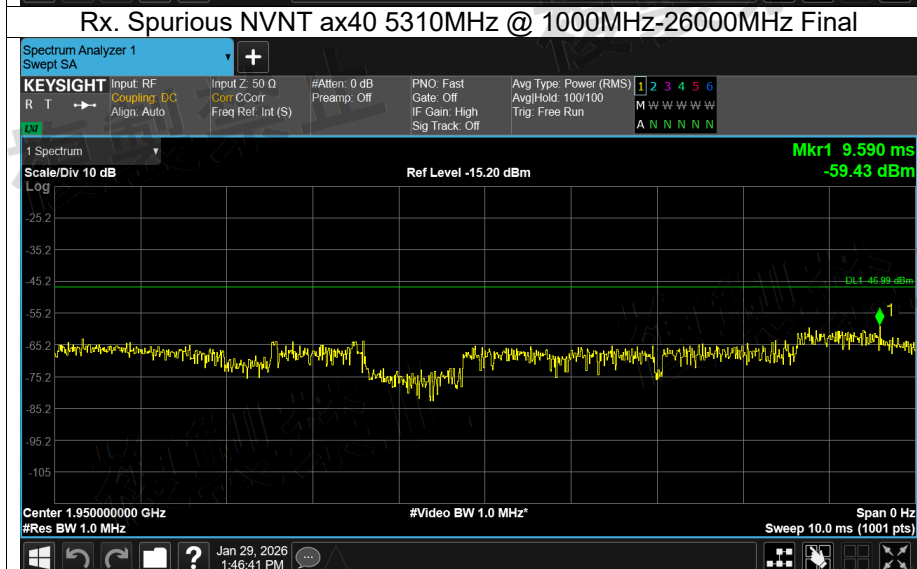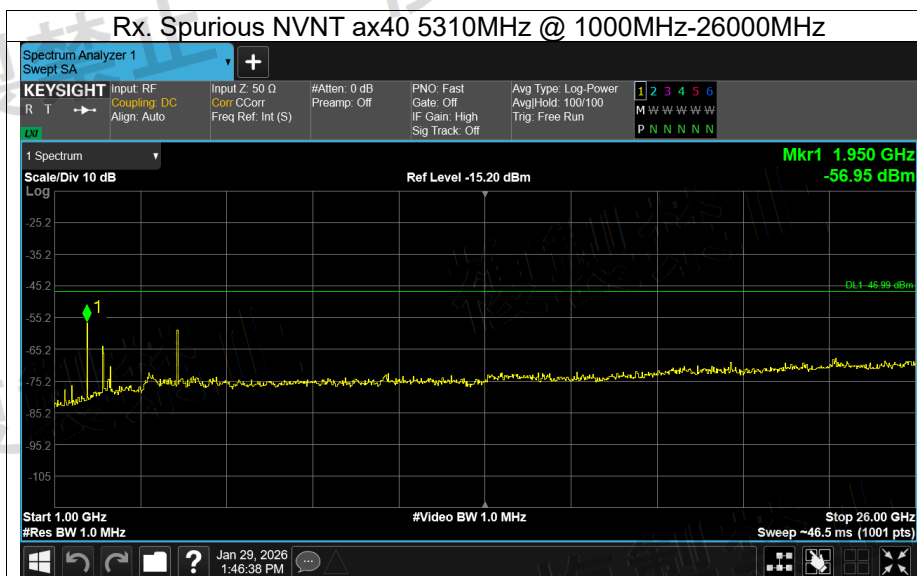

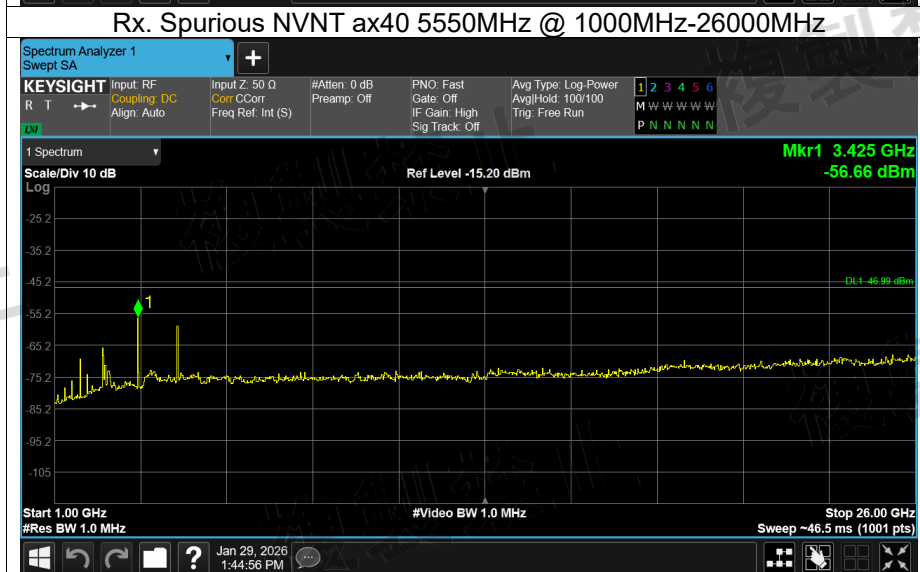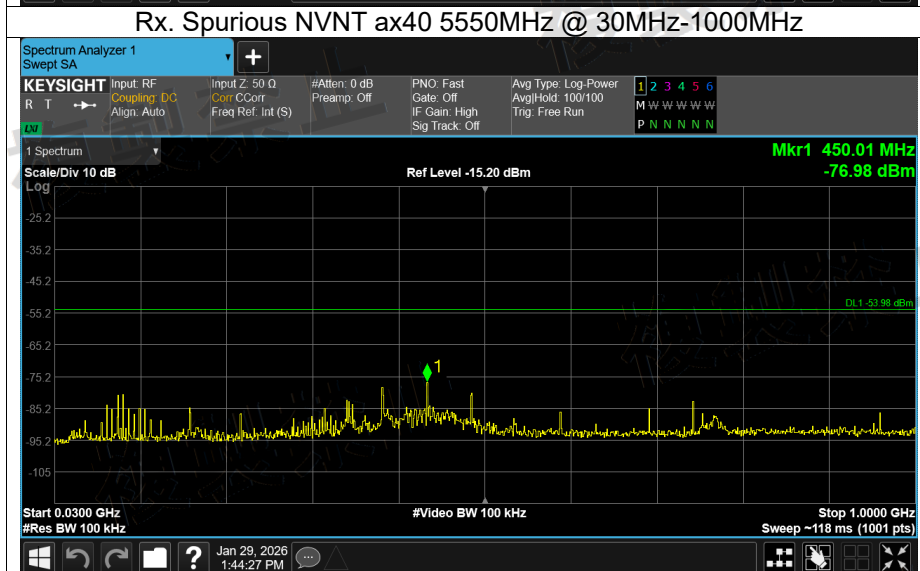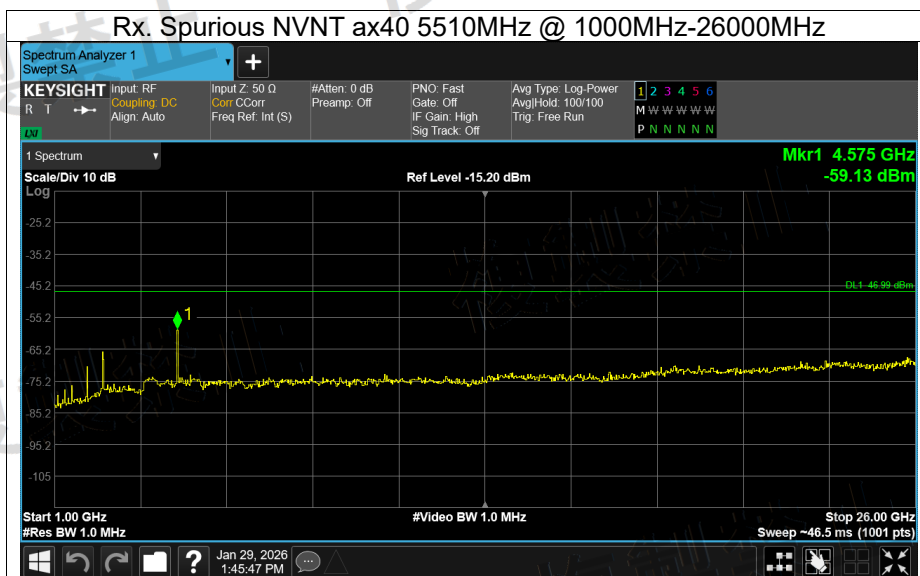

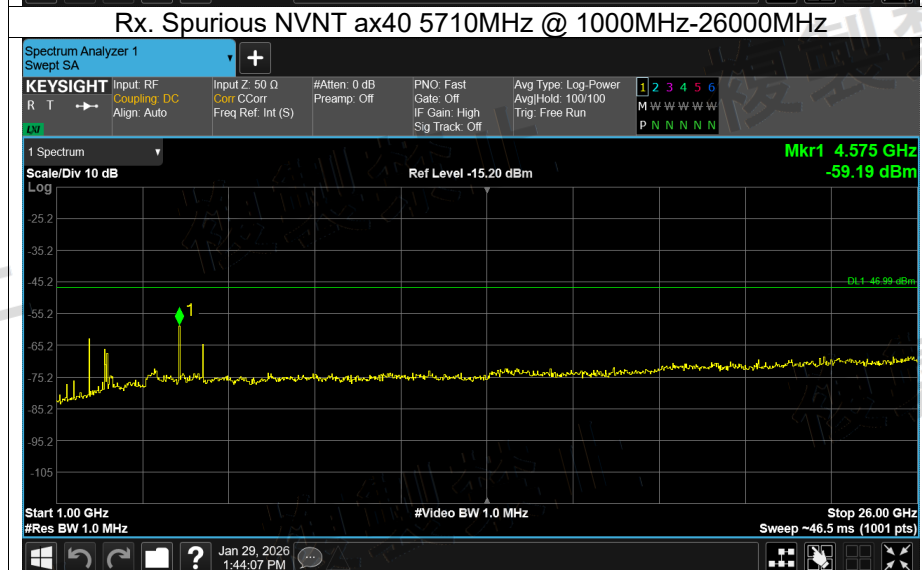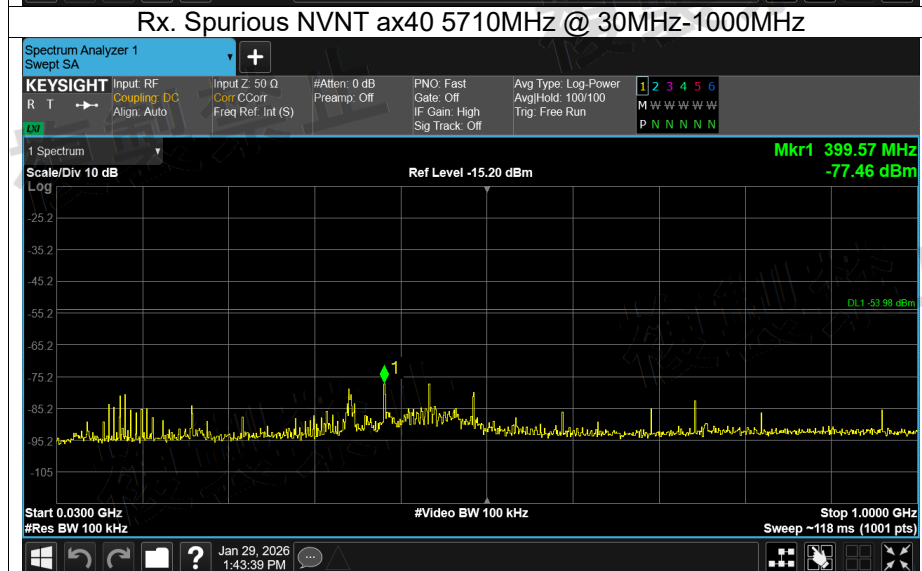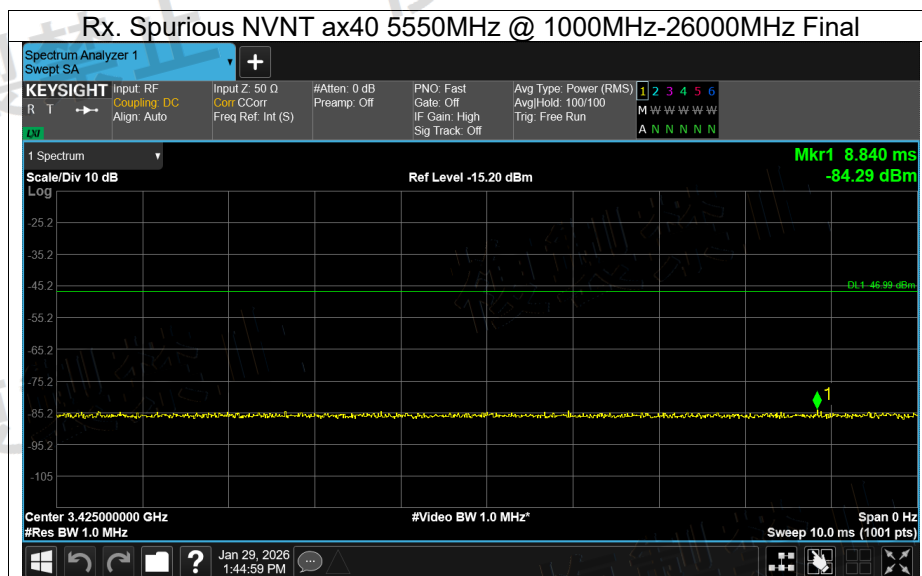



ADJACENT CHANNEL EMITTED POWER

Condition	Mode	Frequency (MHz)	Offset (MHz)	Value (dBc)	Limit (dBc)	Verdict
NVNT	a	5180	-20	-30.12	-25	Pass
NVNT	a	5180	-40	-45.35	-40	Pass
NVNT	a	5180	20	-29.85	-25	Pass
NVNT	a	5180	40	-46.24	-40	Pass
NVNT	a	5200	-20	-31.94	-25	Pass
NVNT	a	5200	-40	-46.49	-40	Pass
NVNT	a	5200	20	-31.62	-25	Pass
NVNT	a	5200	40	-47.6	-40	Pass
NVNT	a	5240	-20	-31.51	-25	Pass
NVNT	a	5240	-40	-47.33	-40	Pass
NVNT	a	5240	20	-31.27	-25	Pass
NVNT	a	5240	40	-48.38	-40	Pass
NVNT	a	5260	-20	-31.06	-25	Pass
NVNT	a	5260	-40	-44.76	-40	Pass
NVNT	a	5260	20	-31.74	-25	Pass
NVNT	a	5260	40	-45.81	-40	Pass
NVNT	a	5300	-20	-31.38	-25	Pass
NVNT	a	5300	-40	-44.87	-40	Pass
NVNT	a	5300	20	-31.11	-25	Pass
NVNT	a	5300	40	-45.35	-40	Pass
NVNT	a	5320	-20	-31.35	-25	Pass
NVNT	a	5320	-40	-45.03	-40	Pass
NVNT	a	5320	20	-31.6	-25	Pass
NVNT	a	5320	40	-45.19	-40	Pass
NVNT	a	5500	-20	-31.41	-25	Pass
NVNT	a	5500	-40	-46.24	-40	Pass
NVNT	a	5500	20	-30.67	-25	Pass
NVNT	a	5500	40	-45.64	-40	Pass
NVNT	a	5580	-20	-31.05	-25	Pass
NVNT	a	5580	-40	-45.77	-40	Pass
NVNT	a	5580	20	-30.97	-25	Pass
NVNT	a	5580	40	-45.61	-40	Pass
NVNT	a	5720	-20	-31.06	-25	Pass
NVNT	a	5720	-40	-46.09	-40	Pass
NVNT	a	5720	20	-31.4	-25	Pass
NVNT	a	5720	40	-46.46	-40	Pass
NVNT	n20	5180	-20	-27.73	-25	Pass
NVNT	n20	5180	-40	-45.76	-40	Pass
NVNT	n20	5180	20	-27.61	-25	Pass
NVNT	n20	5180	40	-46.55	-40	Pass
NVNT	n20	5200	-20	-27.65	-25	Pass
NVNT	n20	5200	-40	-45.9	-40	Pass
NVNT	n20	5200	20	-27.47	-25	Pass
NVNT	n20	5200	40	-46.84	-40	Pass
NVNT	n20	5240	-20	-27.73	-25	Pass
NVNT	n20	5240	-40	-46.71	-40	Pass
NVNT	n20	5240	20	-27.48	-25	Pass
NVNT	n20	5240	40	-47.71	-40	Pass
NVNT	n20	5260	-20	-27.64	-25	Pass
NVNT	n20	5260	-40	-44.34	-40	Pass
NVNT	n20	5260	20	-28.45	-25	Pass
NVNT	n20	5260	40	-45.31	-40	Pass
NVNT	n20	5300	-20	-28.25	-25	Pass
NVNT	n20	5300	-40	-44.13	-40	Pass
NVNT	n20	5300	20	-28.44	-25	Pass
NVNT	n20	5300	40	-44.76	-40	Pass
NVNT	n20	5320	-20	-27.78	-25	Pass
NVNT	n20	5320	-40	-44.44	-40	Pass






NVNT	n20	5320	20	-28.2	-25	Pass
NVNT	n20	5320	40	-44.72	-40	Pass
NVNT	n20	5500	-20	-27.45	-25	Pass
NVNT	n20	5500	-40	-45.87	-40	Pass
NVNT	n20	5500	20	-27.38	-25	Pass
NVNT	n20	5500	40	-45.22	-40	Pass
NVNT	n20	5580	-20	-26.8	-25	Pass
NVNT	n20	5580	-40	-45.21	-40	Pass
NVNT	n20	5580	20	-27.69	-25	Pass
NVNT	n20	5580	40	-44.95	-40	Pass
NVNT	n20	5720	-20	-27.64	-25	Pass
NVNT	n20	5720	-40	-45.97	-40	Pass
NVNT	n20	5720	20	-27.02	-25	Pass
NVNT	n20	5720	40	-46.28	-40	Pass
NVNT	n40	5190	-40	-33.47	-25	Pass
NVNT	n40	5190	-80	-42.15	-40	Pass
NVNT	n40	5190	40	-32.55	-25	Pass
NVNT	n40	5190	80	-44.12	-40	Pass
NVNT	n40	5230	-40	-32.58	-25	Pass
NVNT	n40	5230	-80	-42.68	-40	Pass
NVNT	n40	5230	40	-33.06	-25	Pass
NVNT	n40	5230	80	-44.67	-40	Pass
NVNT	n40	5270	-40	-32.62	-25	Pass
NVNT	n40	5270	-80	-40.3	-40	Pass
NVNT	n40	5270	40	-33.92	-25	Pass
NVNT	n40	5270	80	-41.79	-40	Pass
NVNT	n40	5310	-40	-32.02	-25	Pass
NVNT	n40	5310	-80	-40.28	-40	Pass
NVNT	n40	5310	40	-32.78	-25	Pass
NVNT	n40	5310	80	-41.08	-40	Pass
NVNT	n40	5510	-40	-31.45	-25	Pass
NVNT	n40	5510	-80	-42.63	-40	Pass
NVNT	n40	5510	40	-30.98	-25	Pass
NVNT	n40	5510	80	-41.77	-40	Pass
NVNT	n40	5550	-40	-31.52	-25	Pass
NVNT	n40	5550	-80	-42.25	-40	Pass
NVNT	n40	5550	40	-31.32	-25	Pass
NVNT	n40	5550	80	-41.72	-40	Pass
NVNT	n40	5710	-40	-32.23	-25	Pass
NVNT	n40	5710	-80	-42.37	-40	Pass
NVNT	n40	5710	40	-31.91	-25	Pass
NVNT	n40	5710	80	-42.81	-40	Pass
NVNT	ac20	5180	-20	-28.3	-25	Pass
NVNT	ac20	5180	-40	-46	-40	Pass
NVNT	ac20	5180	20	-27.94	-25	Pass
NVNT	ac20	5180	40	-46.98	-40	Pass
NVNT	ac20	5200	-20	-27.98	-25	Pass
NVNT	ac20	5200	-40	-46.11	-40	Pass
NVNT	ac20	5200	20	-27.86	-25	Pass
NVNT	ac20	5200	40	-47.06	-40	Pass
NVNT	ac20	5240	-20	-27.86	-25	Pass
NVNT	ac20	5240	-40	-46.79	-40	Pass
NVNT	ac20	5240	20	-27.71	-25	Pass
NVNT	ac20	5240	40	-47.85	-40	Pass
NVNT	ac20	5260	-20	-26.94	-25	Pass
NVNT	ac20	5260	-40	-44.03	-40	Pass
NVNT	ac20	5260	20	-28.24	-25	Pass
NVNT	ac20	5260	40	-44.91	-40	Pass
NVNT	ac20	5300	-20	-27.24	-25	Pass
NVNT	ac20	5300	-40	-44.22	-40	Pass
NVNT	ac20	5300	20	-27.43	-25	Pass









NVNT	ac20	5300	40	-44.72	-40	Pass
NVNT	ac20	5320	-20	-28.4	-25	Pass
NVNT	ac20	5320	-40	-44.39	-40	Pass
NVNT	ac20	5320	20	-28.23	-25	Pass
NVNT	ac20	5320	40	-44.73	-40	Pass
NVNT	ac20	5500	-20	-27.3	-25	Pass
NVNT	ac20	5500	-40	-46.05	-40	Pass
NVNT	ac20	5500	20	-27.32	-25	Pass
NVNT	ac20	5500	40	-45.33	-40	Pass
NVNT	ac20	5580	-20	-26.51	-25	Pass
NVNT	ac20	5580	-40	-45.03	-40	Pass
NVNT	ac20	5580	20	-26.68	-25	Pass
NVNT	ac20	5580	40	-44.92	-40	Pass
NVNT	ac20	5720	-20	-27.46	-25	Pass
NVNT	ac20	5720	-40	-45.44	-40	Pass
NVNT	ac20	5720	20	-27.3	-25	Pass
NVNT	ac20	5720	40	-45.68	-40	Pass
NVNT	ac40	5190	-40	-32.22	-25	Pass
NVNT	ac40	5190	-80	-41.99	-40	Pass
NVNT	ac40	5190	40	-34.43	-25	Pass
NVNT	ac40	5190	80	-43.9	-40	Pass
NVNT	ac40	5230	-40	-32.73	-25	Pass
NVNT	ac40	5230	-80	-42.75	-40	Pass
NVNT	ac40	5230	40	-33.79	-25	Pass
NVNT	ac40	5230	80	-44.64	-40	Pass
NVNT	ac40	5270	-40	-34.01	-25	Pass
NVNT	ac40	5270	-80	-41.92	-40	Pass
NVNT	ac40	5270	40	-32.76	-25	Pass
NVNT	ac40	5270	80	-43.41	-40	Pass
NVNT	ac40	5310	-40	-32.7	-25	Pass
NVNT	ac40	5310	-80	-40.5	-40	Pass
NVNT	ac40	5310	40	-33.53	-25	Pass
NVNT	ac40	5310	80	-41.2	-40	Pass
NVNT	ac40	5510	-40	-32.58	-25	Pass
NVNT	ac40	5510	-80	-42.82	-40	Pass
NVNT	ac40	5510	40	-31.49	-25	Pass
NVNT	ac40	5510	80	-41.86	-40	Pass
NVNT	ac40	5550	-40	-31.17	-25	Pass
NVNT	ac40	5550	-80	-42.28	-40	Pass
NVNT	ac40	5550	40	-31.34	-25	Pass
NVNT	ac40	5550	80	-41.64	-40	Pass
NVNT	ac40	5710	-40	-31.74	-25	Pass
NVNT	ac40	5710	-80	-42.23	-40	Pass
NVNT	ac40	5710	40	-32.08	-25	Pass
NVNT	ac40	5710	80	-42.71	-40	Pass
NVNT	ax20	5180	-20	-28.05	-25	Pass
NVNT	ax20	5180	-40	-46.32	-40	Pass
NVNT	ax20	5180	20	-27.05	-25	Pass
NVNT	ax20	5180	40	-46.9	-40	Pass
NVNT	ax20	5200	-20	-28	-25	Pass
NVNT	ax20	5200	-40	-47.05	-40	Pass
NVNT	ax20	5200	20	-26.72	-25	Pass
NVNT	ax20	5200	40	-47.89	-40	Pass
NVNT	ax20	5240	-20	-27.91	-25	Pass
NVNT	ax20	5240	-40	-47.41	-40	Pass
NVNT	ax20	5240	20	-29.79	-25	Pass
NVNT	ax20	5240	40	-48.21	-40	Pass
NVNT	ax20	5260	-20	-26.66	-25	Pass
NVNT	ax20	5260	-40	-44.72	-40	Pass
NVNT	ax20	5260	20	-27.88	-25	Pass
NVNT	ax20	5260	40	-45.68	-40	Pass









NVNT	ax20	5300	-20	-28.25	-25	Pass
NVNT	ax20	5300	-40	-45.05	-40	Pass
NVNT	ax20	5300	20	-28.37	-25	Pass
NVNT	ax20	5300	40	-45.65	-40	Pass
NVNT	ax20	5320	-20	-27.33	-25	Pass
NVNT	ax20	5320	-40	-44.97	-40	Pass
NVNT	ax20	5320	20	-28.34	-25	Pass
NVNT	ax20	5320	40	-45.1	-40	Pass
NVNT	ax20	5500	-20	-28.47	-25	Pass
NVNT	ax20	5500	-40	-46.79	-40	Pass
NVNT	ax20	5500	20	-29.69	-25	Pass
NVNT	ax20	5500	40	-46.04	-40	Pass
NVNT	ax20	5580	-20	-26.89	-25	Pass
NVNT	ax20	5580	-40	-46.04	-40	Pass
NVNT	ax20	5580	20	-28.56	-25	Pass
NVNT	ax20	5580	40	-45.92	-40	Pass
NVNT	ax20	5720	-20	-27.29	-25	Pass
NVNT	ax20	5720	-40	-46.53	-40	Pass
NVNT	ax20	5720	20	-27.53	-25	Pass
NVNT	ax20	5720	40	-46.81	-40	Pass
NVNT	ax40	5190	-40	-36.75	-25	Pass
NVNT	ax40	5190	-80	-42.83	-40	Pass
NVNT	ax40	5190	40	-34.18	-25	Pass
NVNT	ax40	5190	80	-44.84	-40	Pass
NVNT	ax40	5230	-40	-33.06	-25	Pass
NVNT	ax40	5230	-80	-42.02	-40	Pass
NVNT	ax40	5230	40	-32.63	-25	Pass
NVNT	ax40	5230	80	-44.01	-40	Pass
NVNT	ax40	5270	-40	-32.16	-25	Pass
NVNT	ax40	5270	-80	-42.75	-40	Pass
NVNT	ax40	5270	40	-32.43	-25	Pass
NVNT	ax40	5270	80	-44.3	-40	Pass
NVNT	ax40	5310	-40	-33.38	-25	Pass
NVNT	ax40	5310	-80	-43.04	-40	Pass
NVNT	ax40	5310	40	-32.93	-25	Pass
NVNT	ax40	5310	80	-43.9	-40	Pass
NVNT	ax40	5510	-40	-32.44	-25	Pass
NVNT	ax40	5510	-80	-42.53	-40	Pass
NVNT	ax40	5510	40	-30.95	-25	Pass
NVNT	ax40	5510	80	-41.65	-40	Pass
NVNT	ax40	5550	-40	-30.4	-25	Pass
NVNT	ax40	5550	-80	-42.85	-40	Pass
NVNT	ax40	5550	40	-31.5	-25	Pass
NVNT	ax40	5550	80	-42.25	-40	Pass
NVNT	ax40	5710	-40	-32.8	-25	Pass
NVNT	ax40	5710	-80	-42.31	-40	Pass
NVNT	ax40	5710	40	-31.88	-25	Pass
NVNT	ax40	5710	80	-42.8	-40	Pass

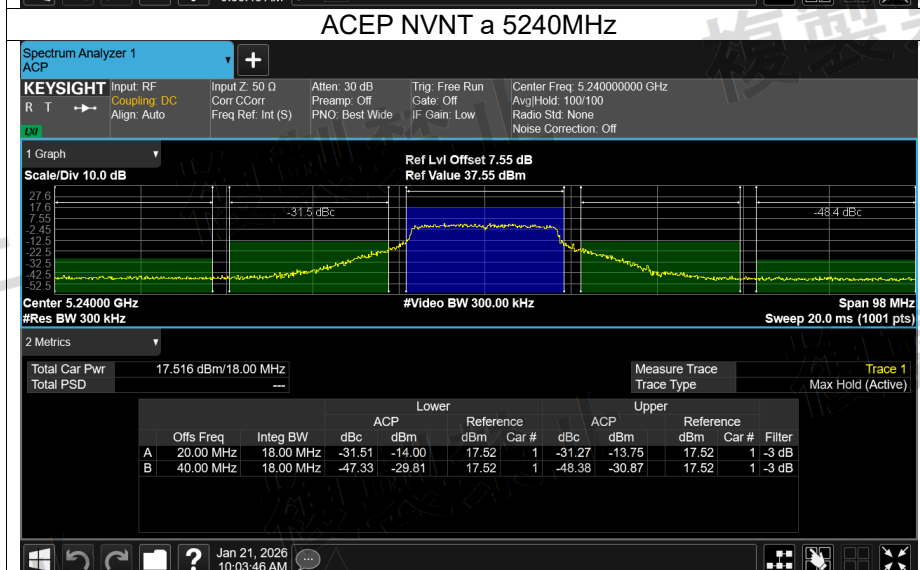
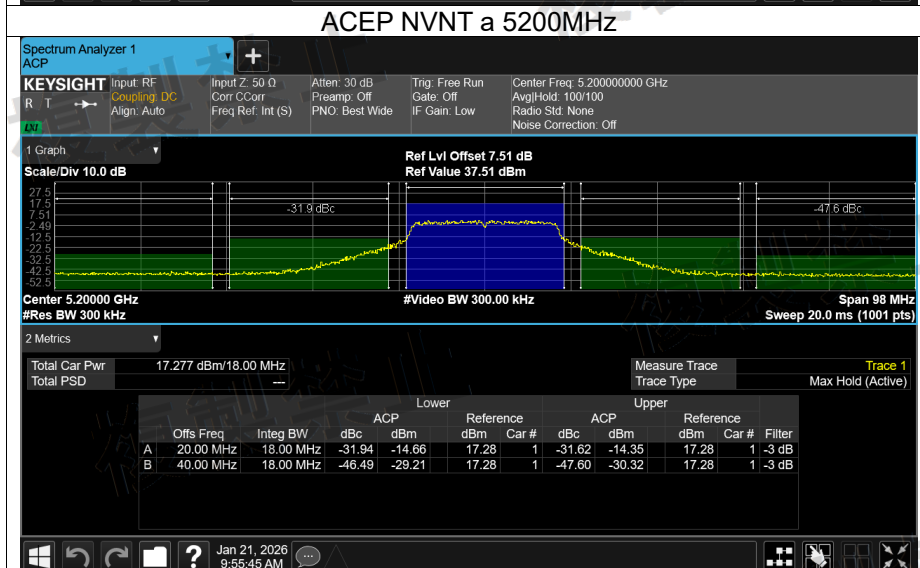
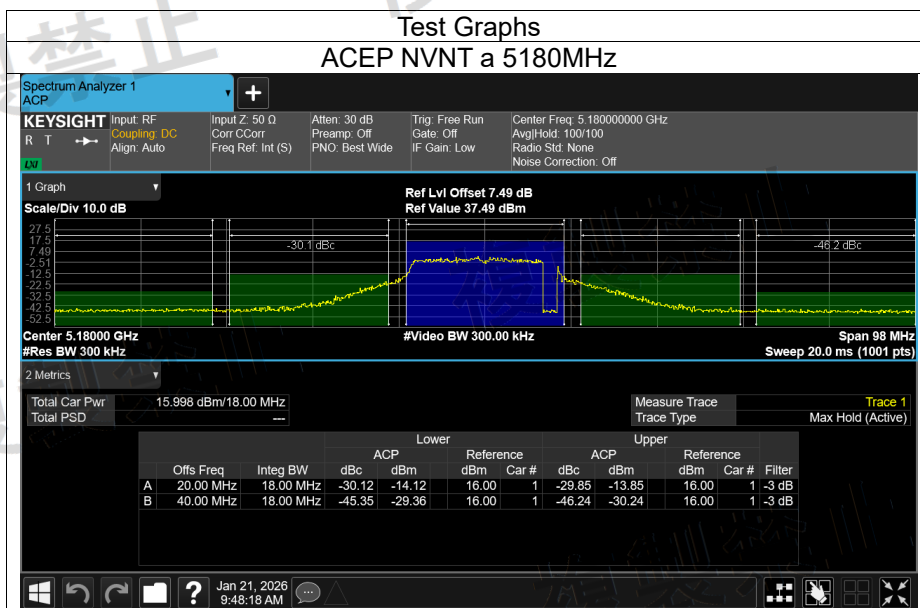


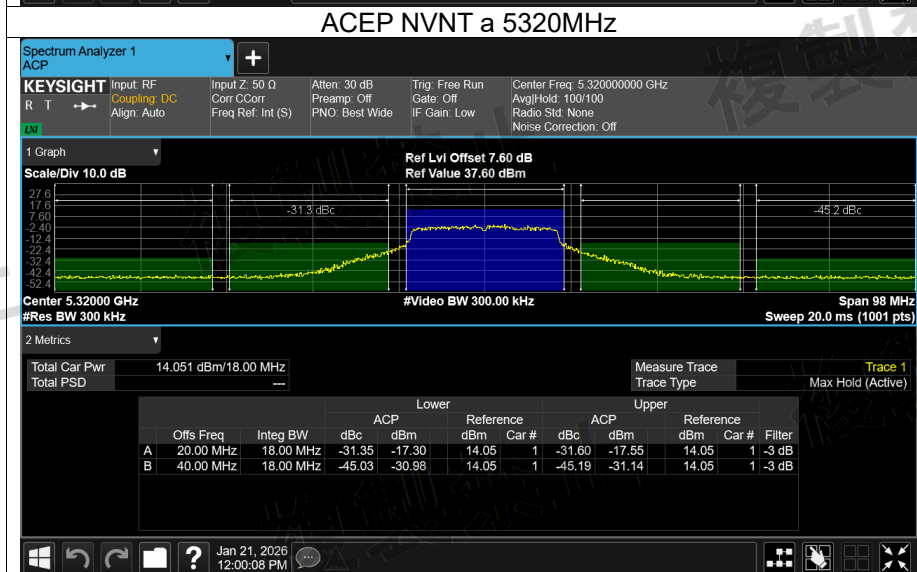
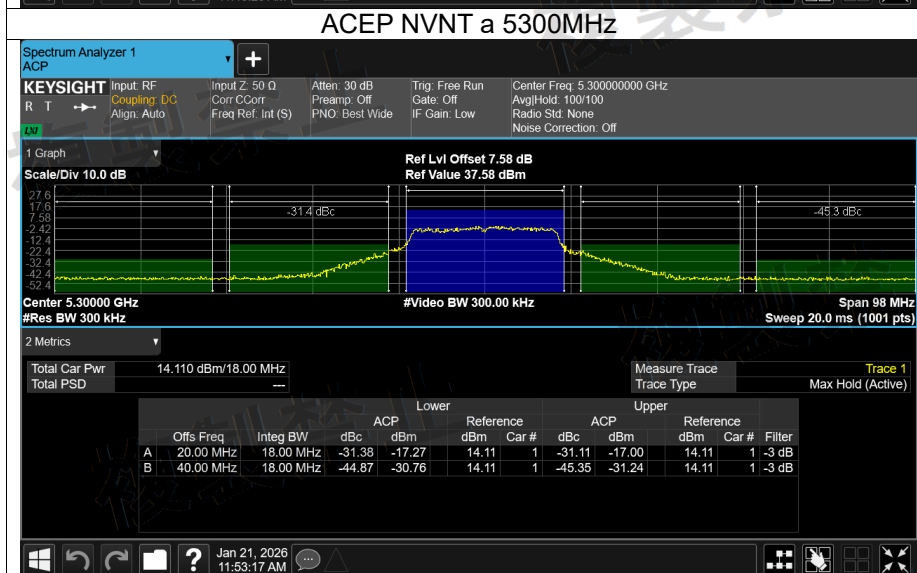
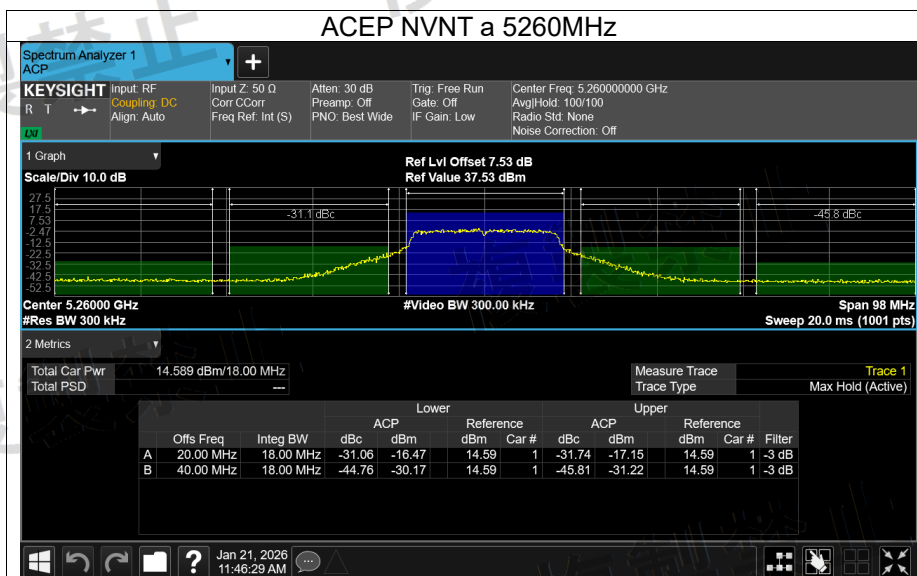


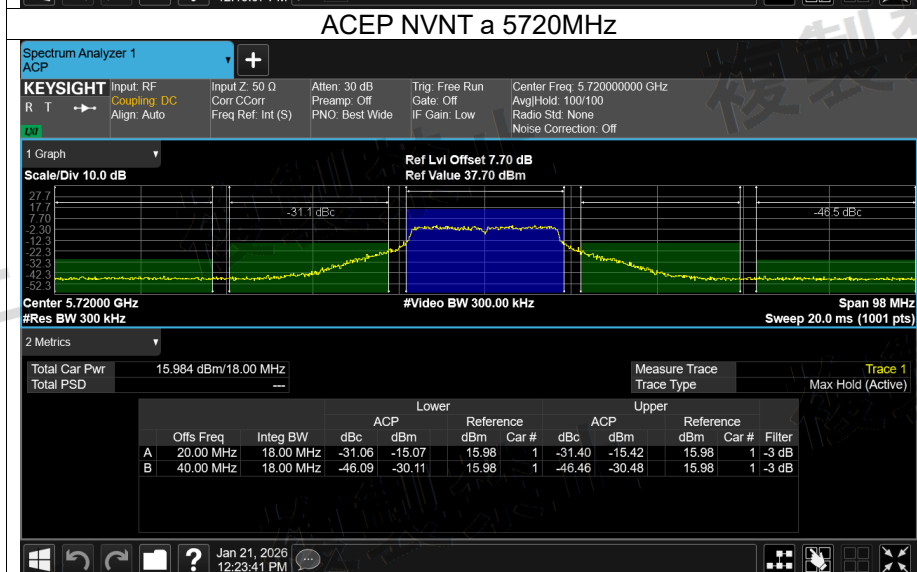
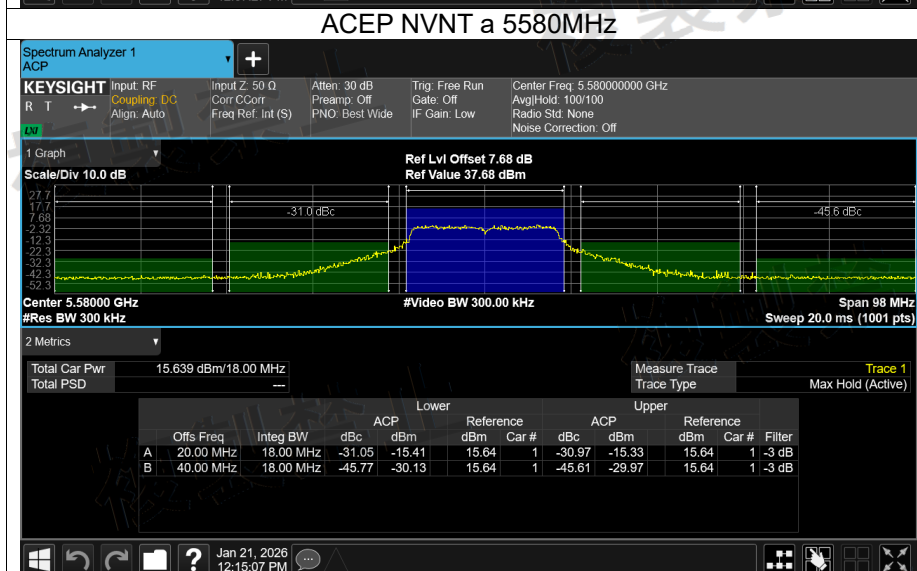
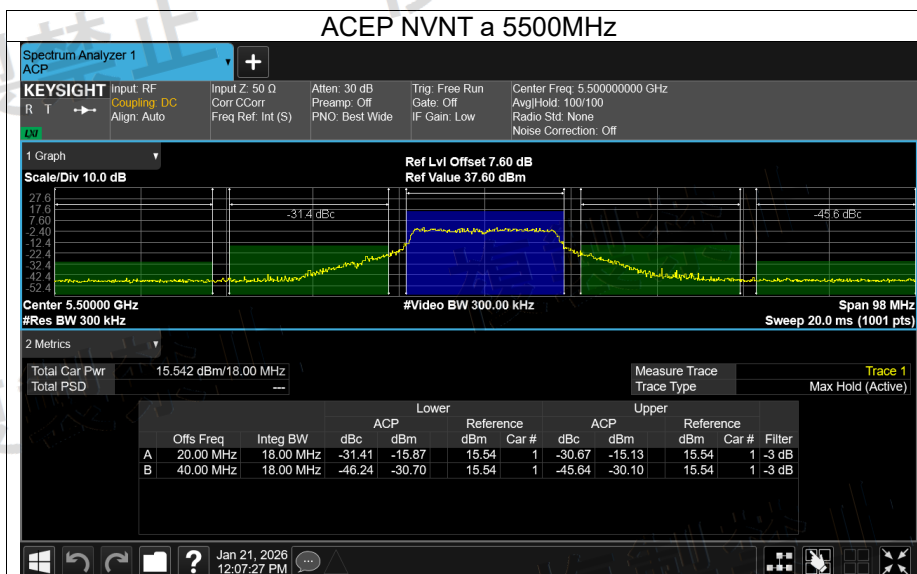


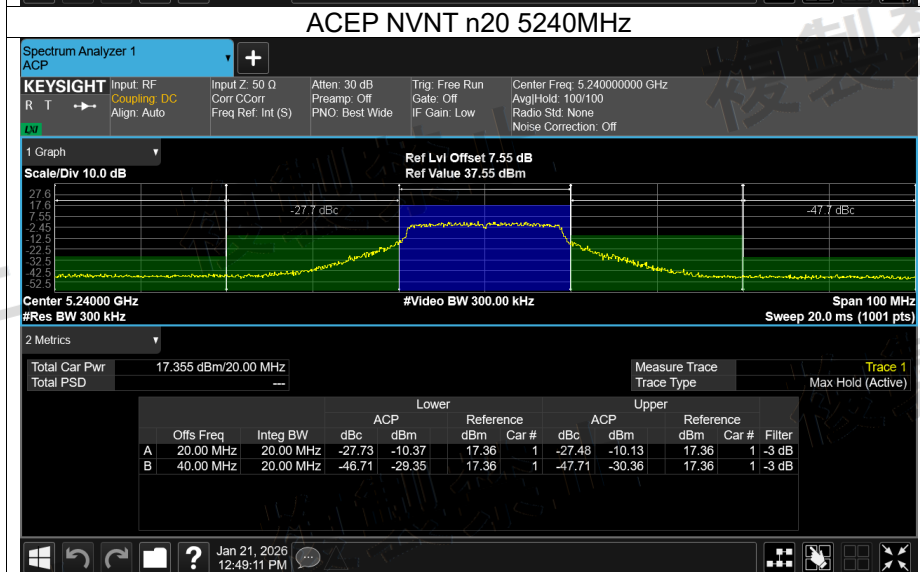
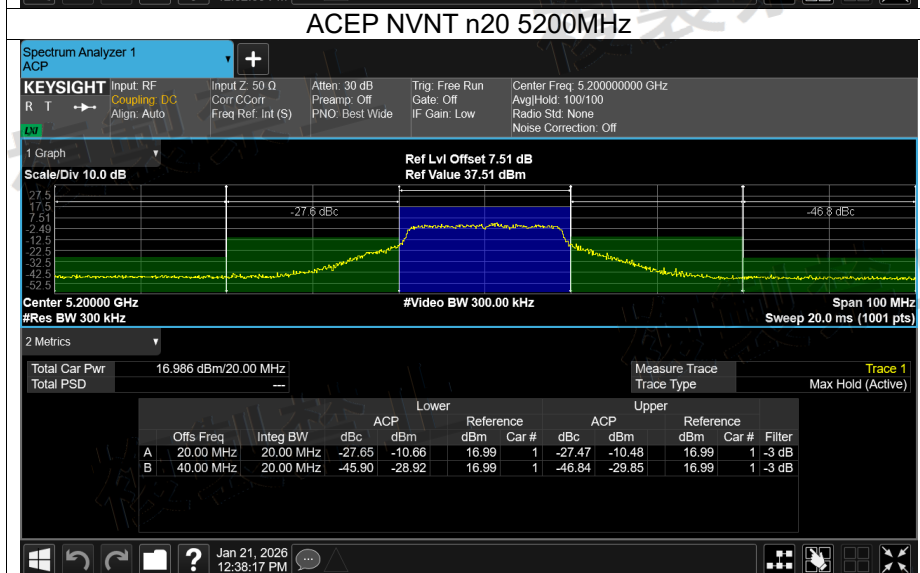
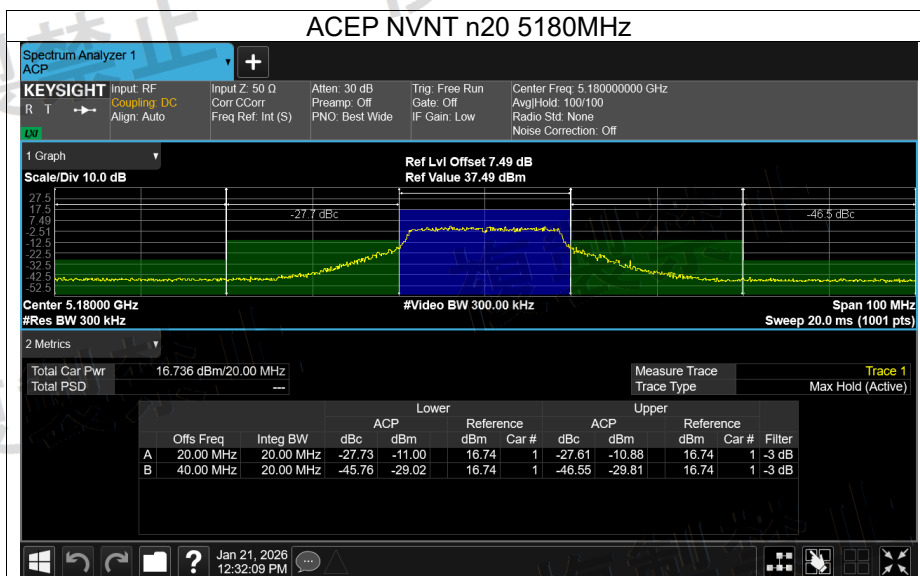


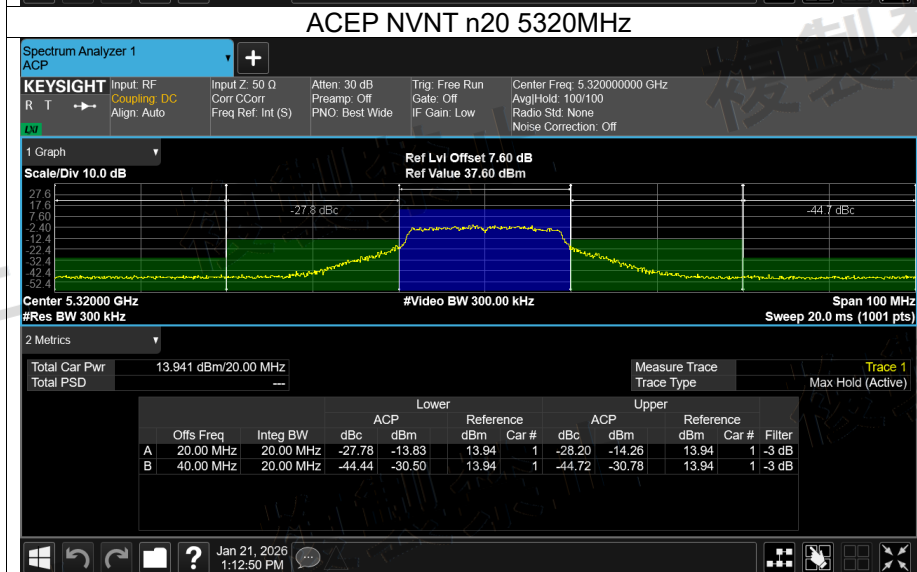
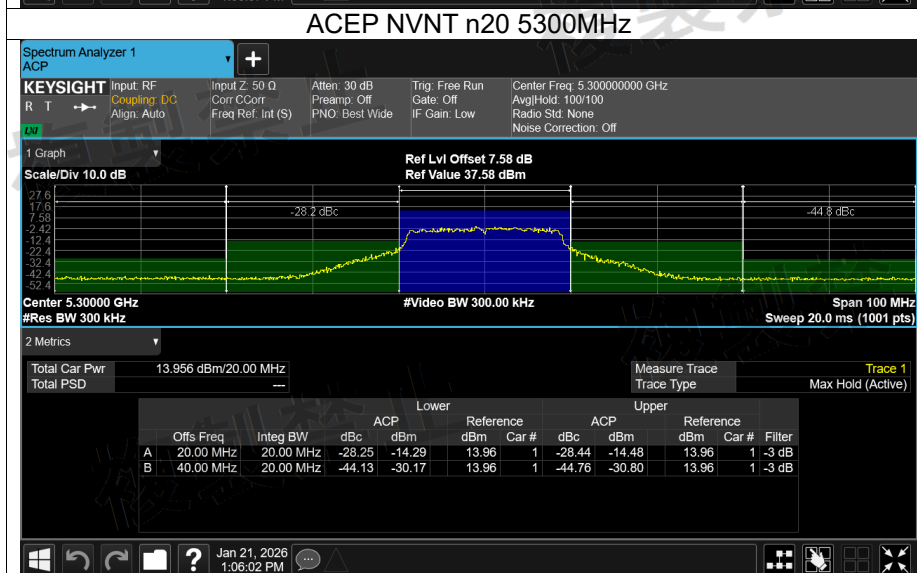
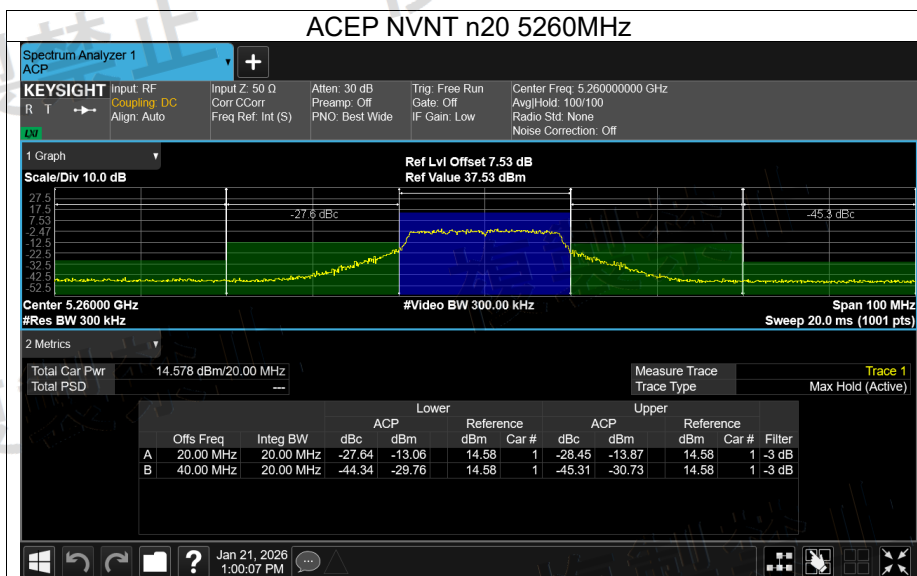


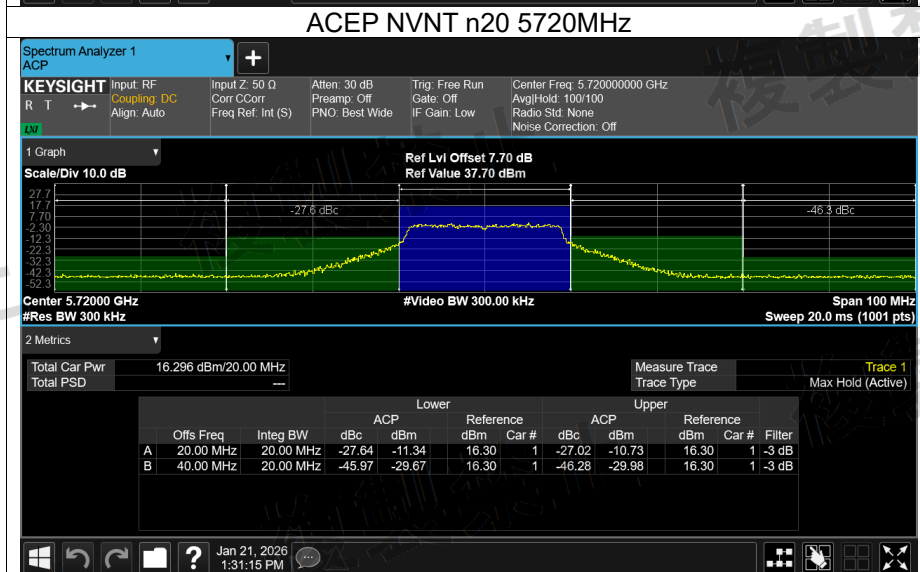
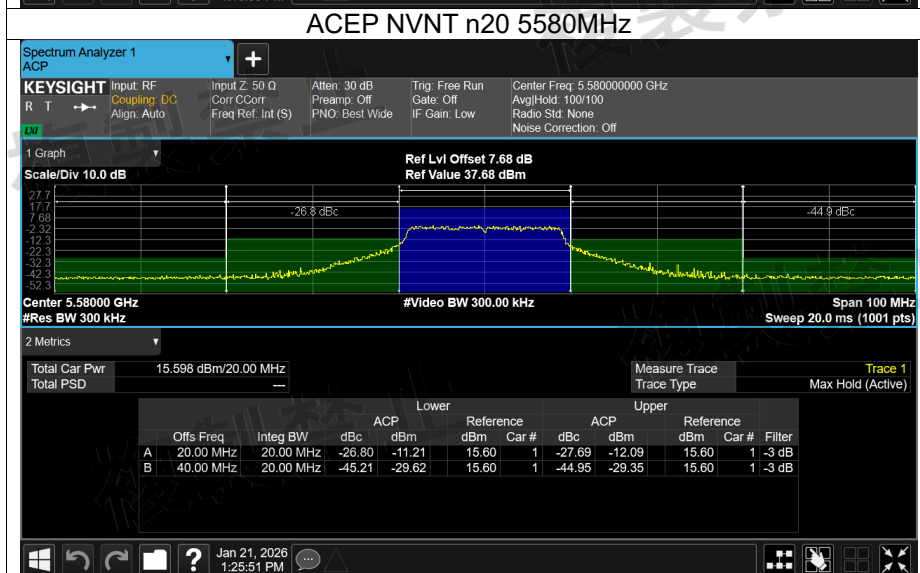
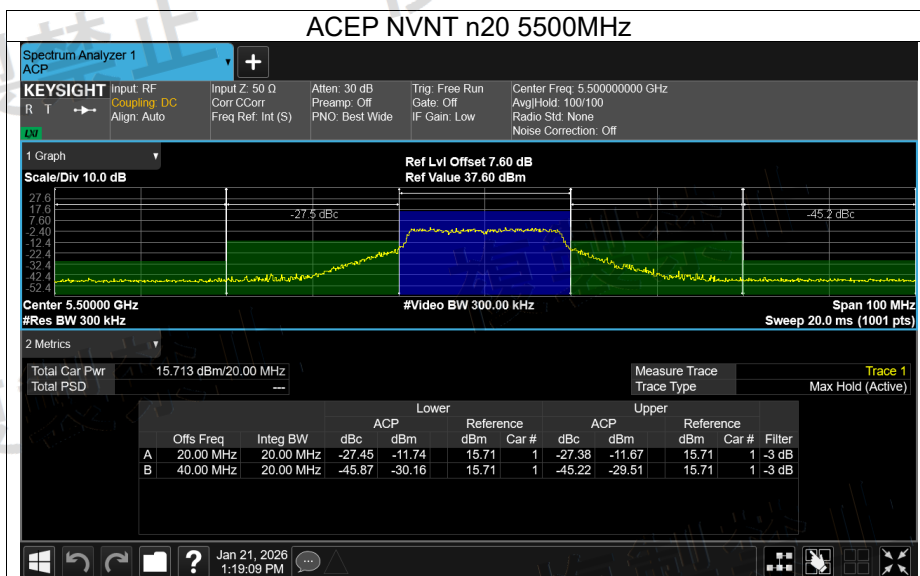


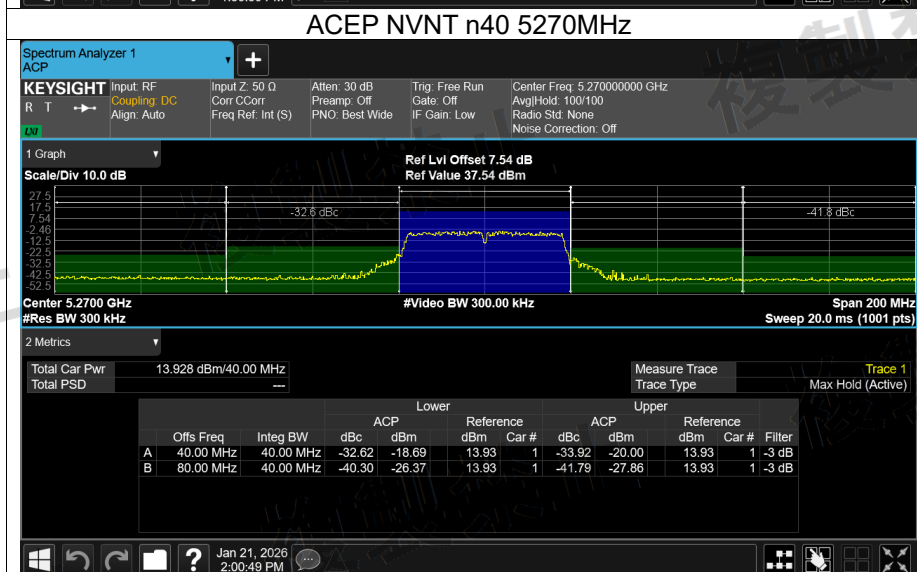
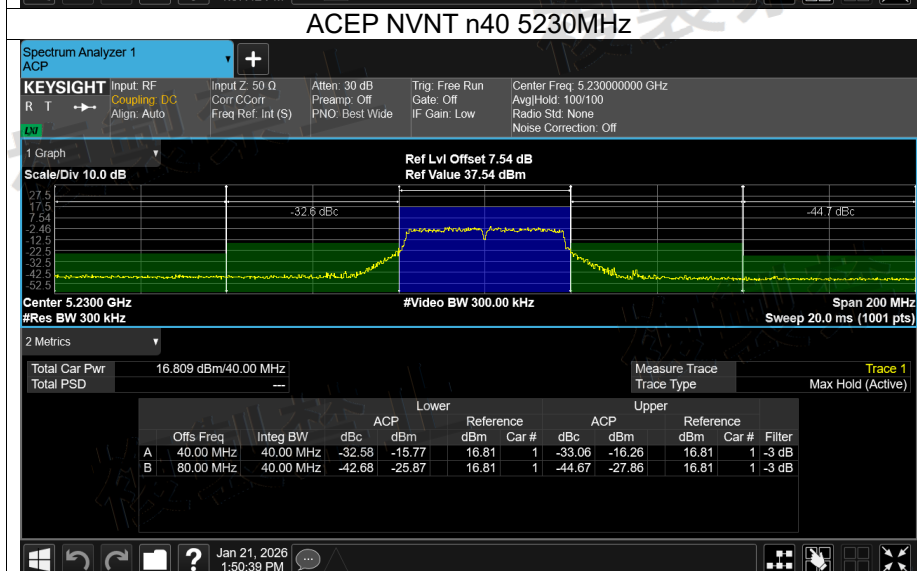
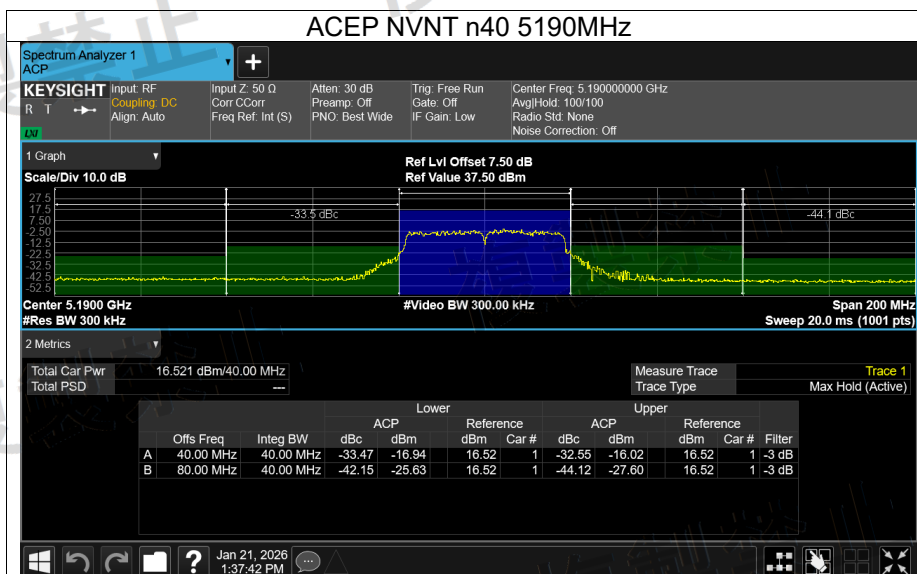


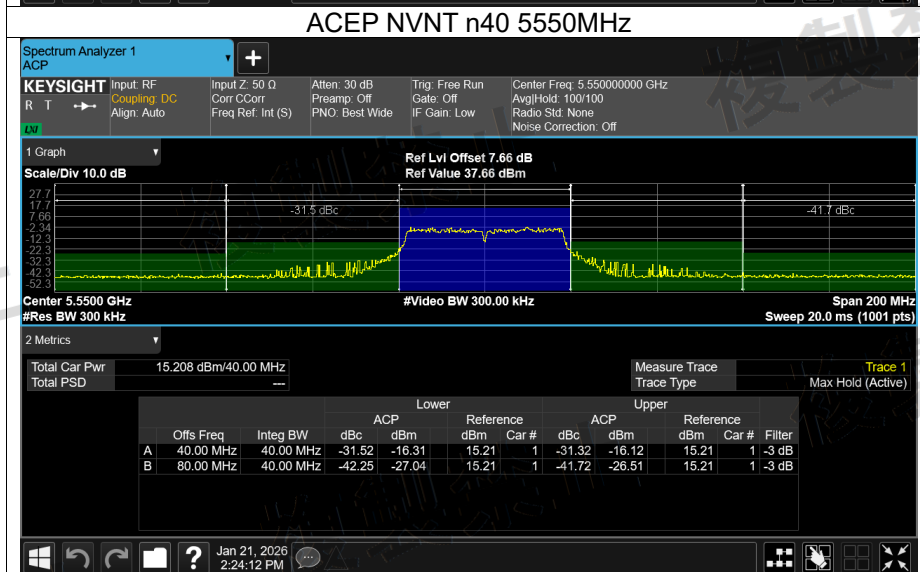
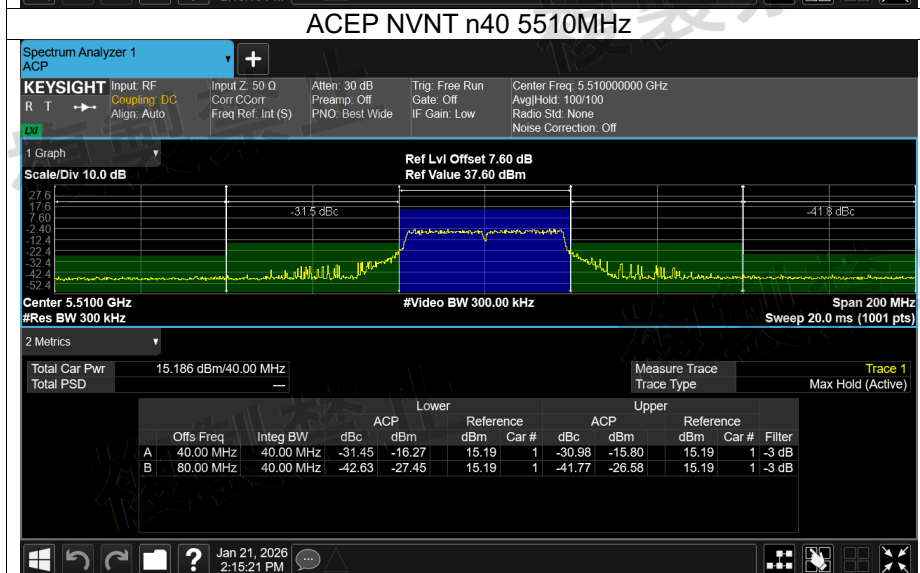
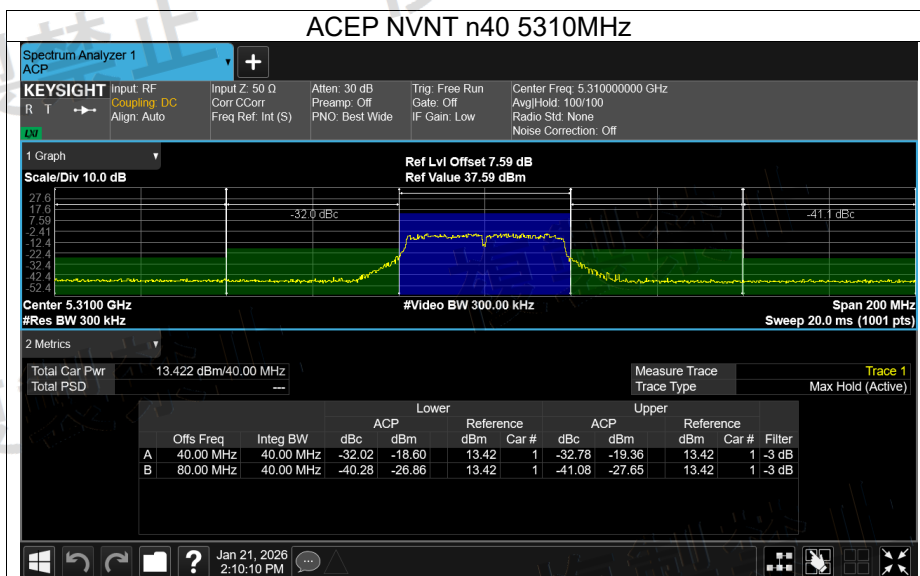


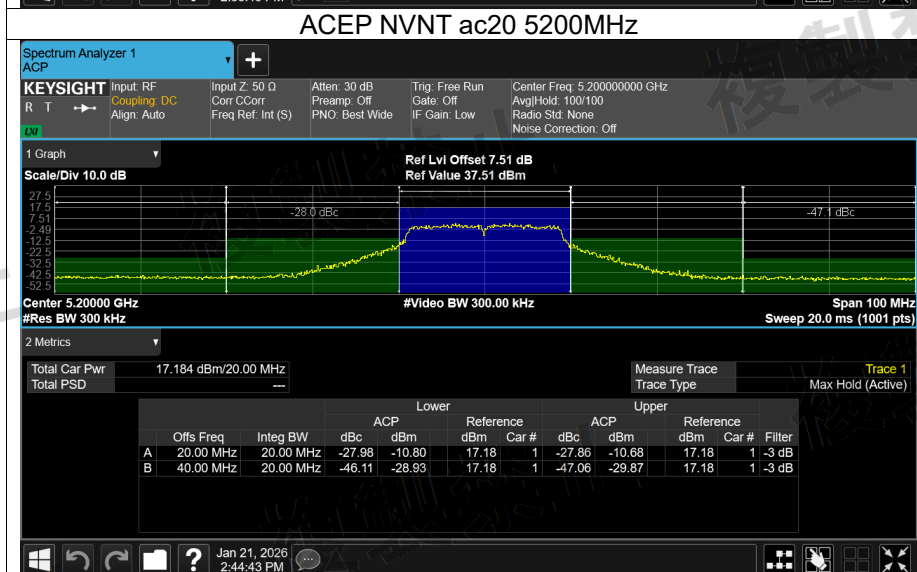
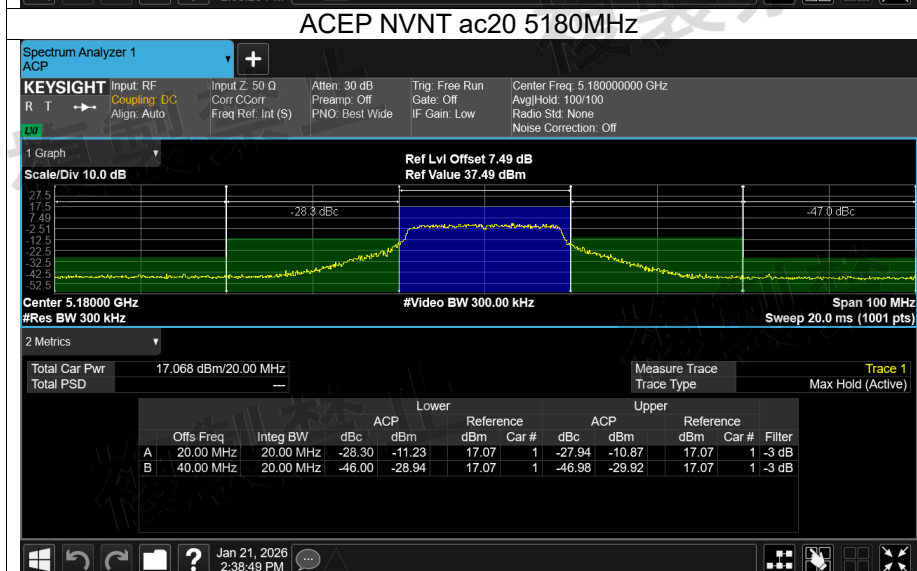
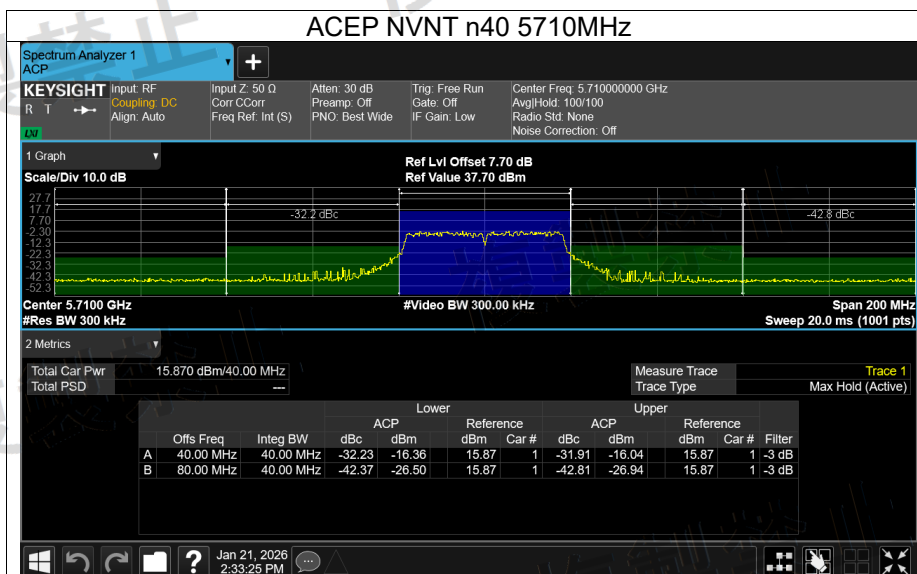


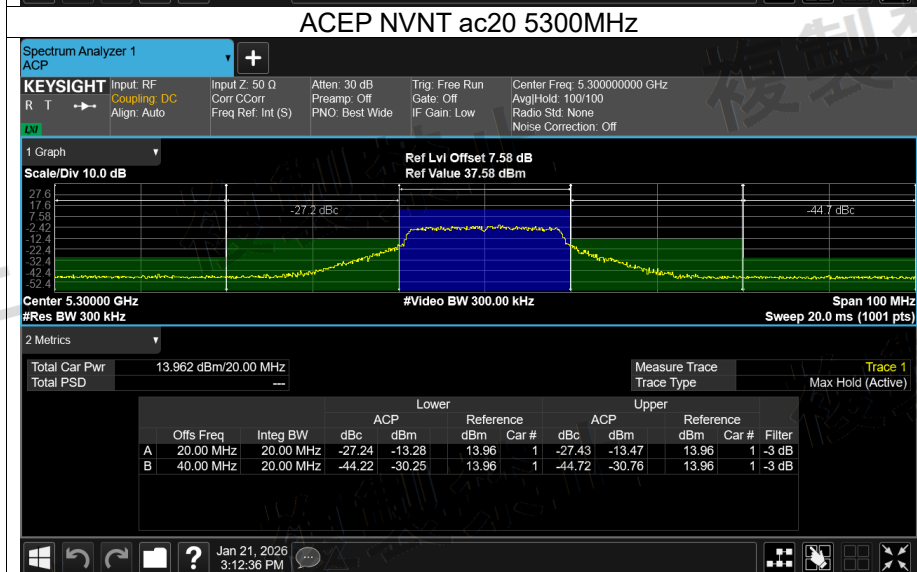
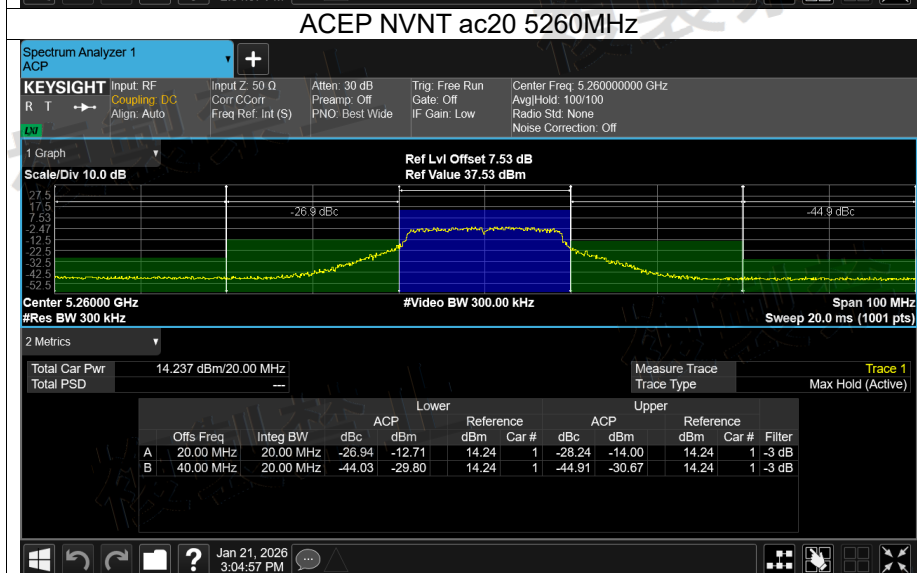
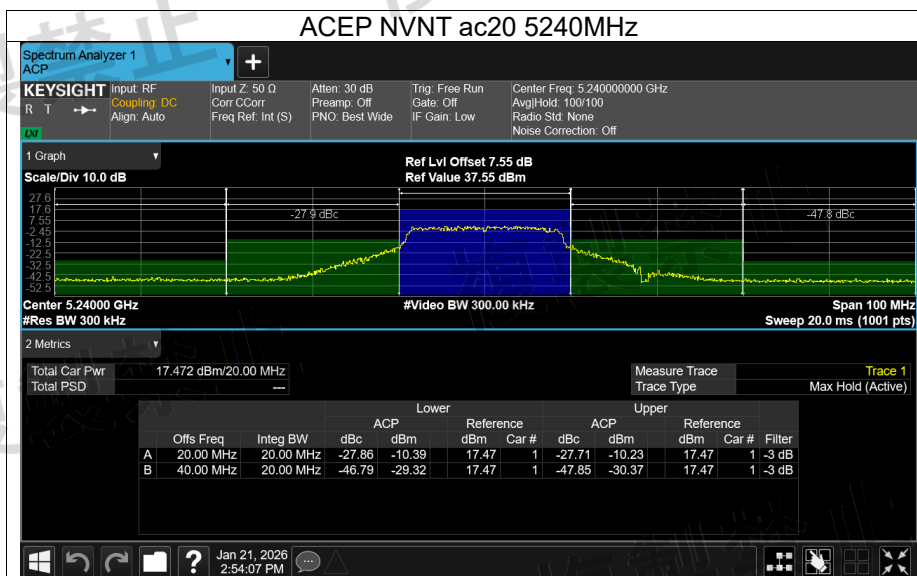


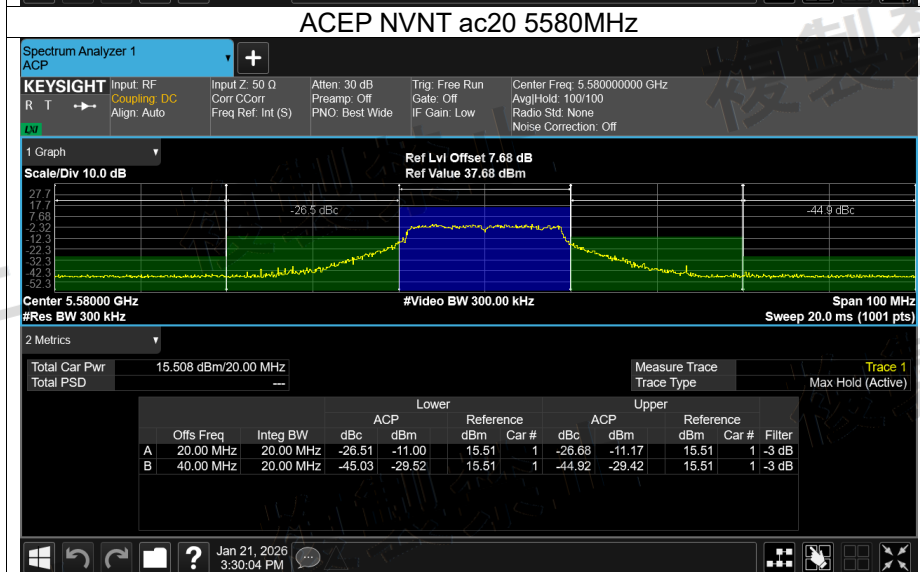
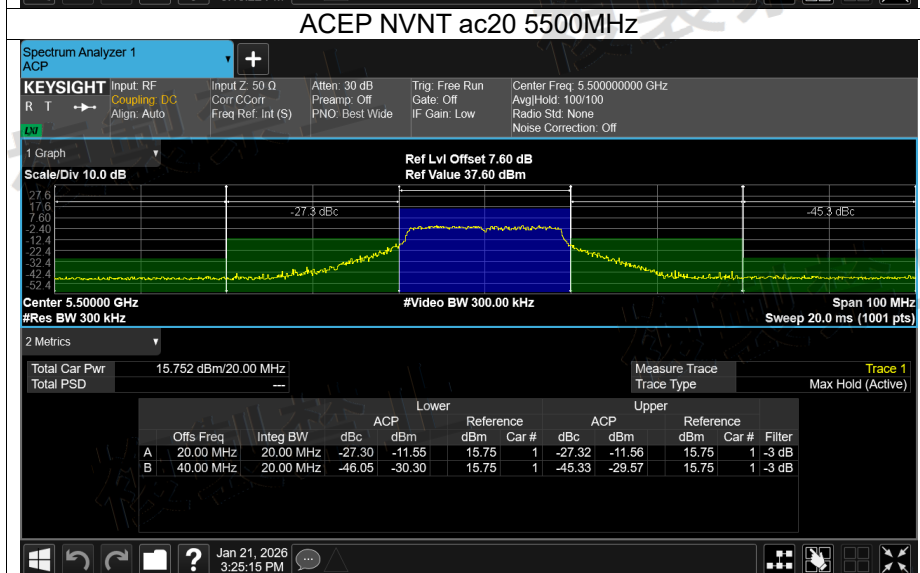
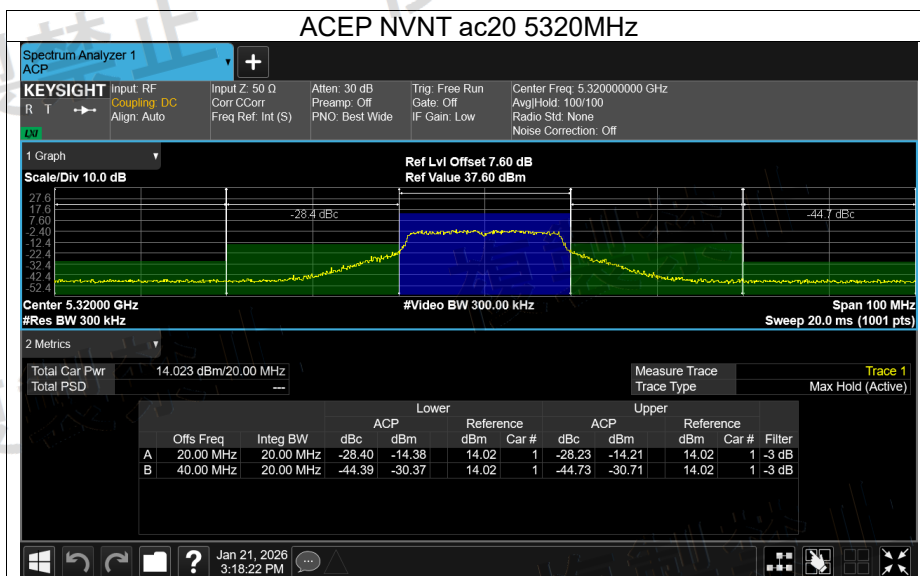


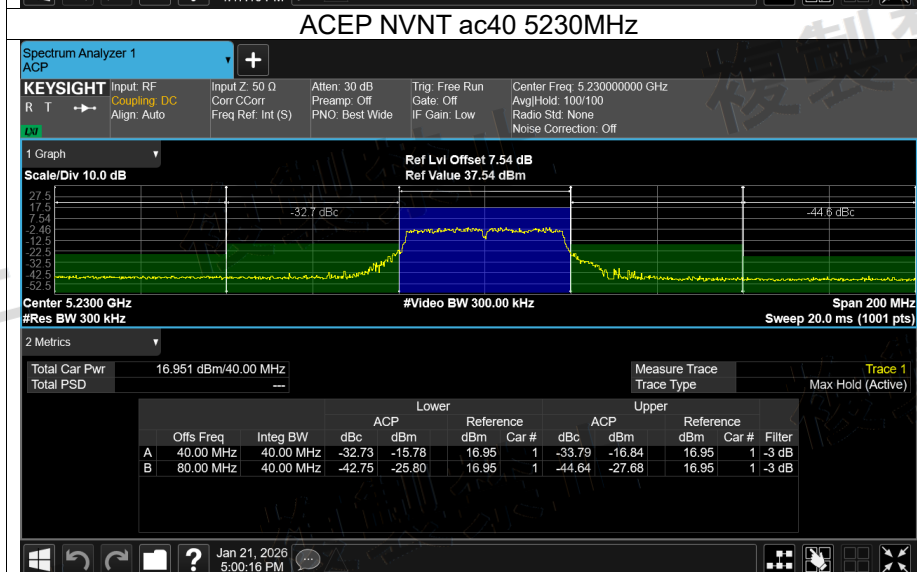
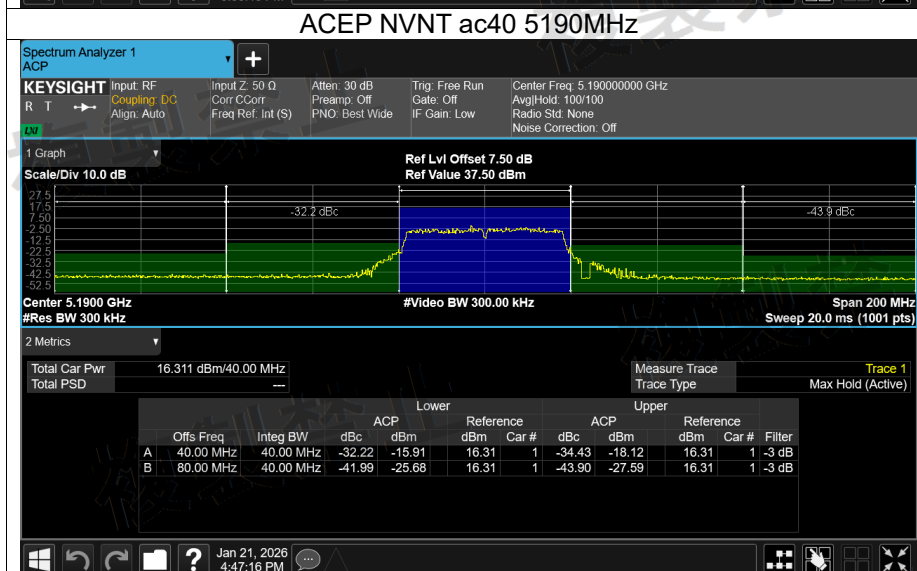
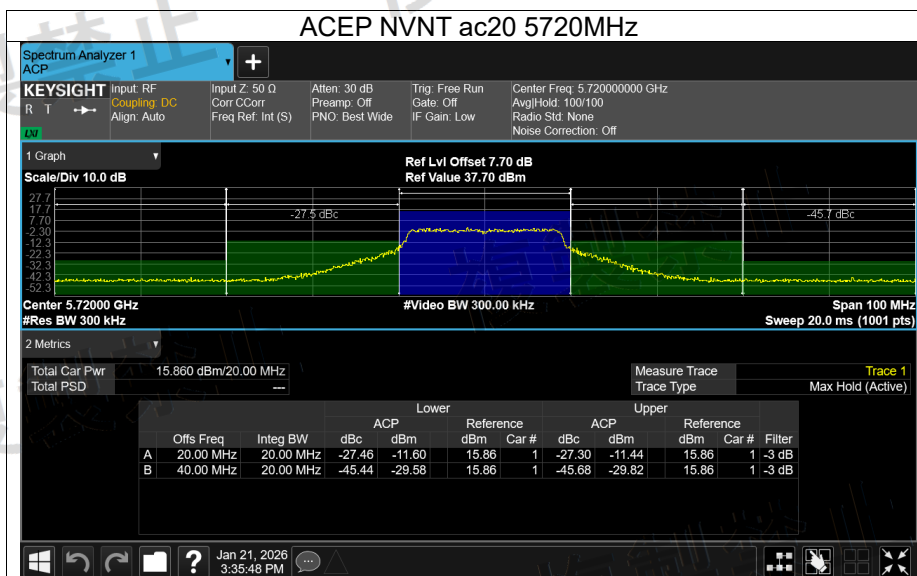


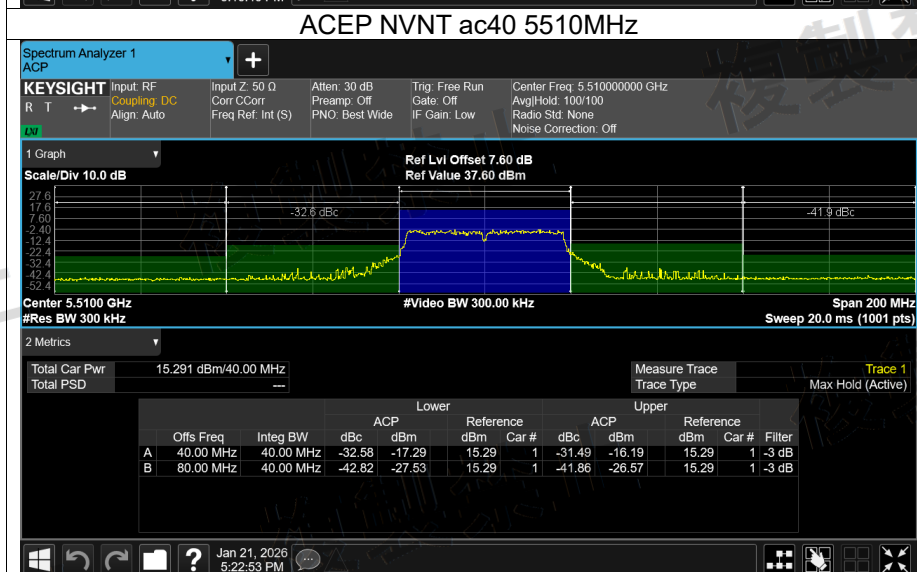
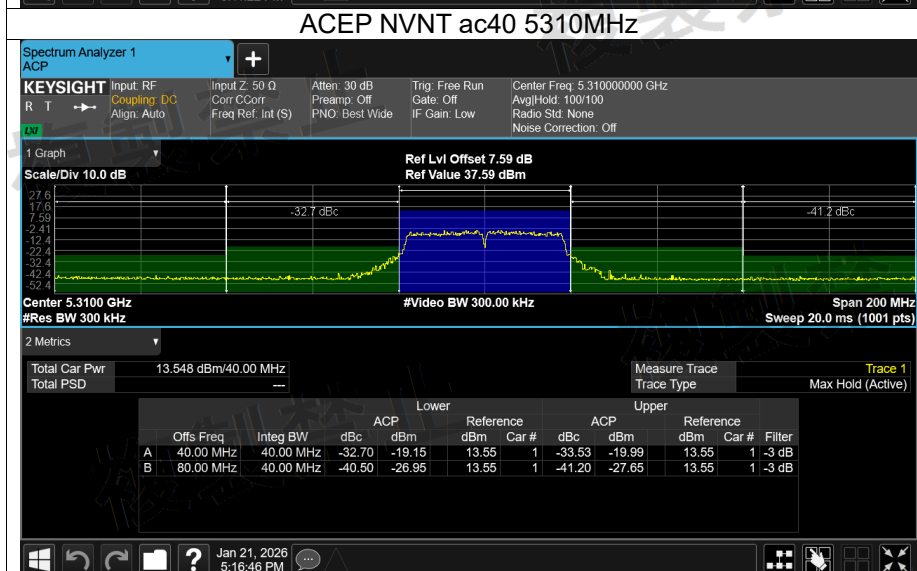
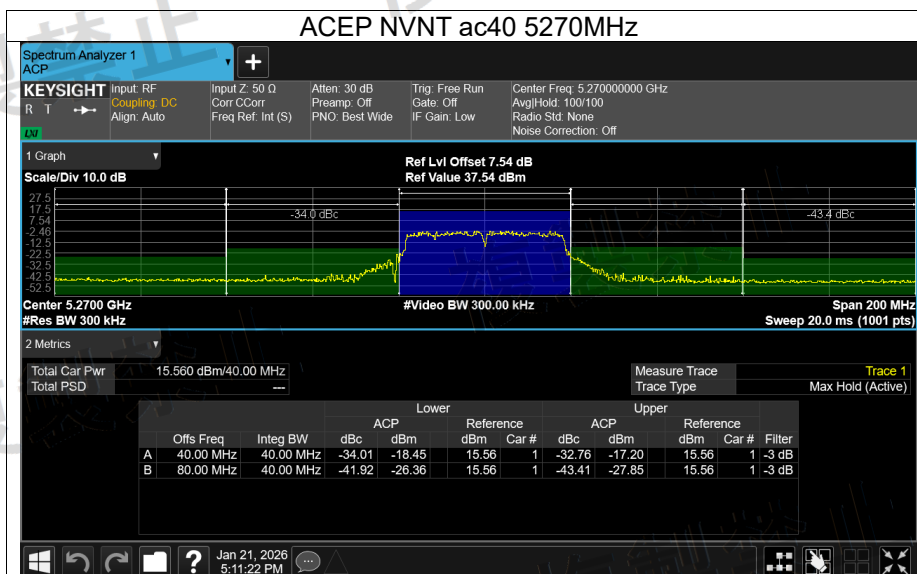


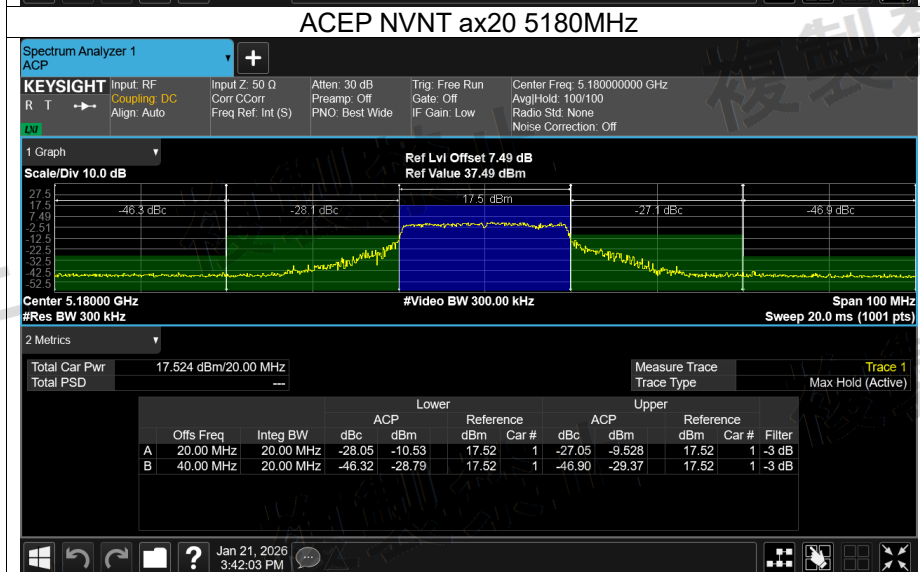
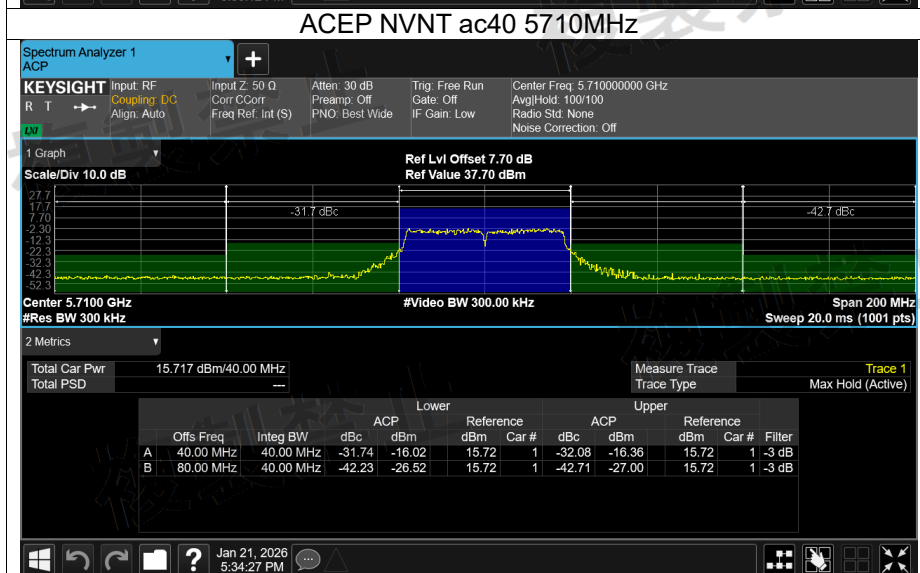
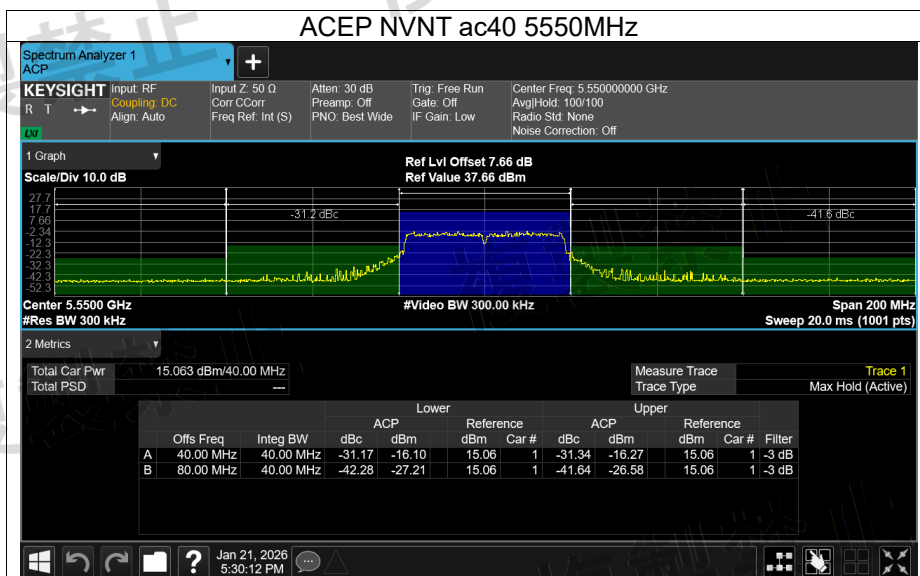


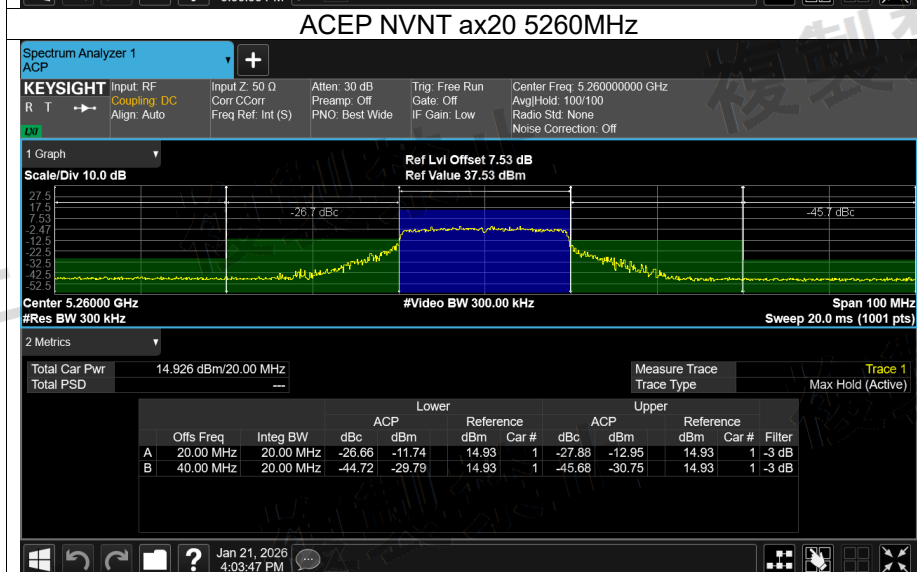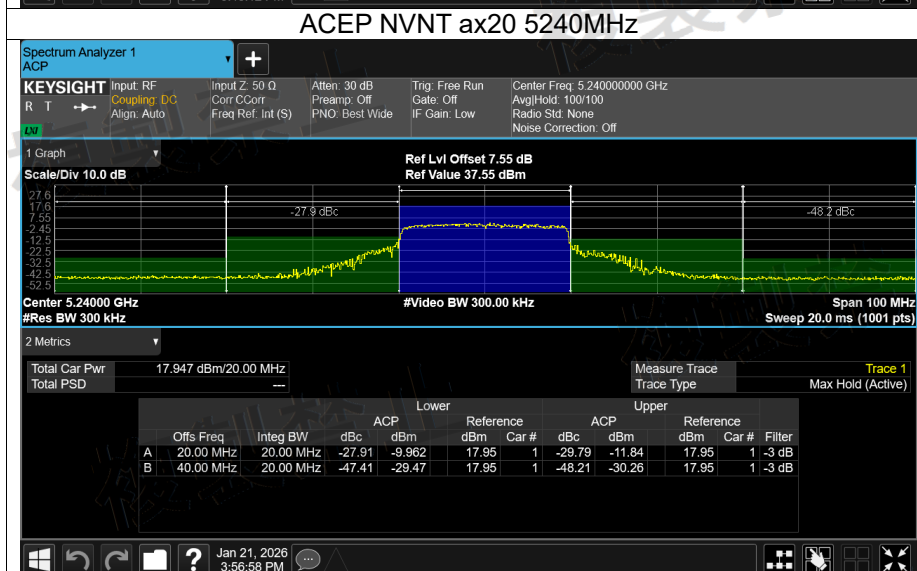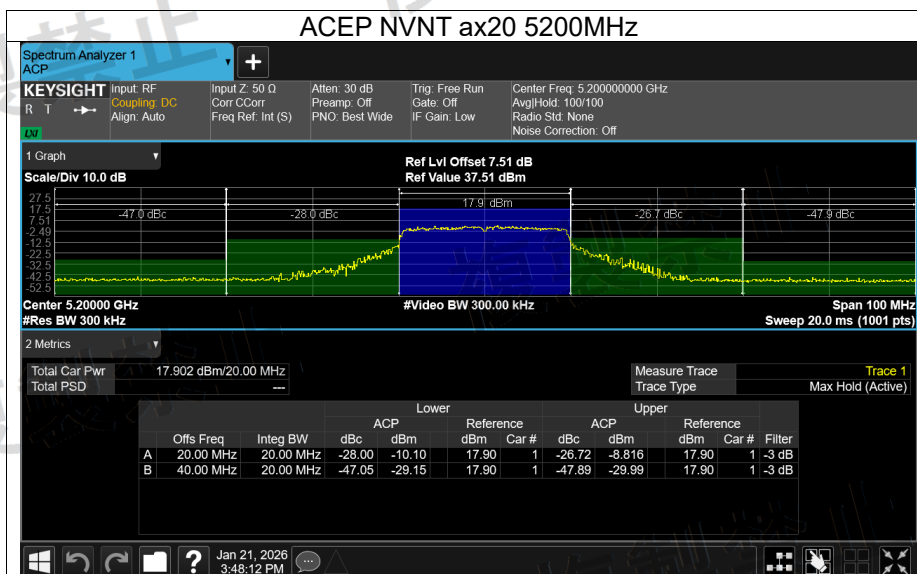

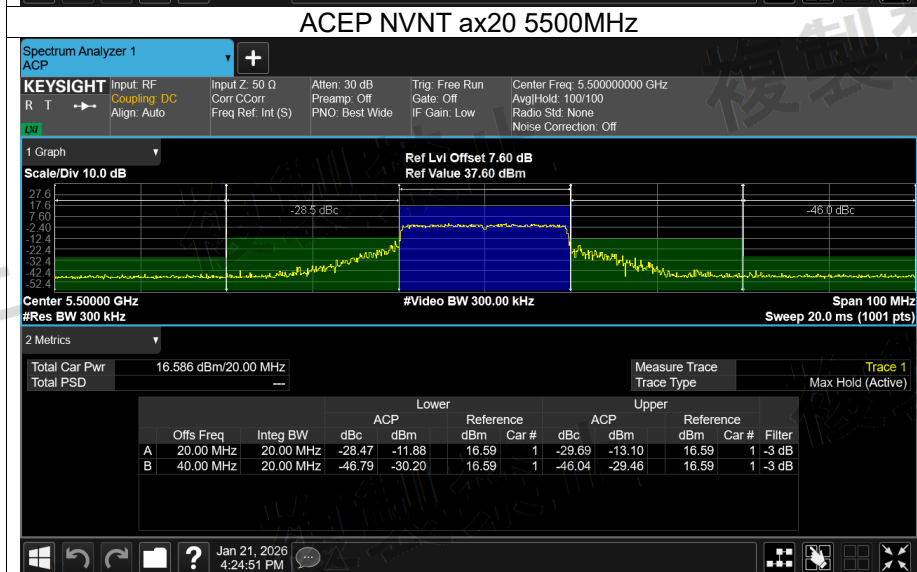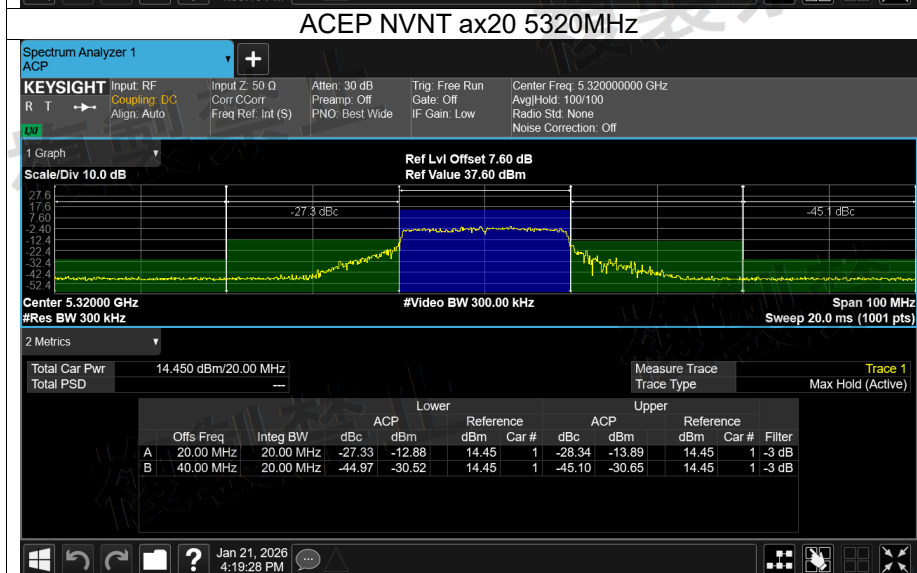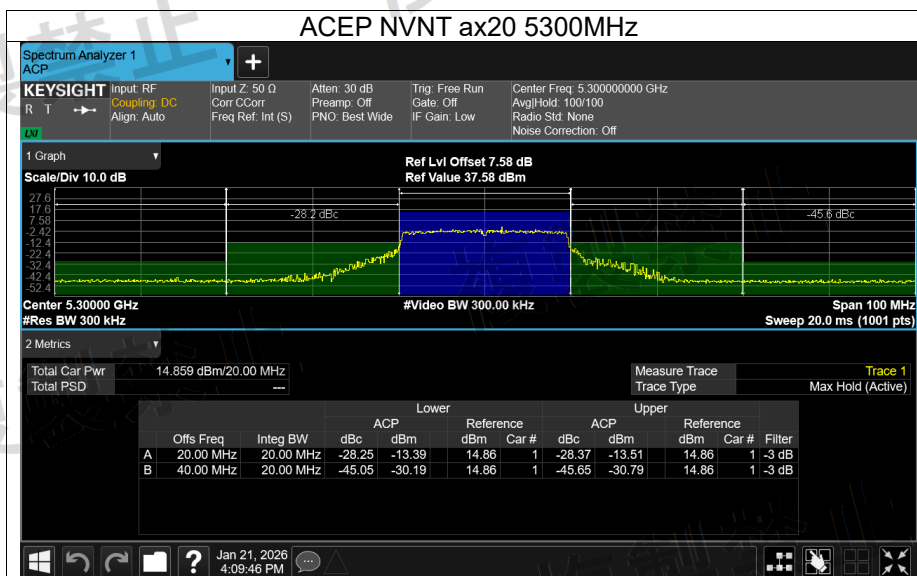

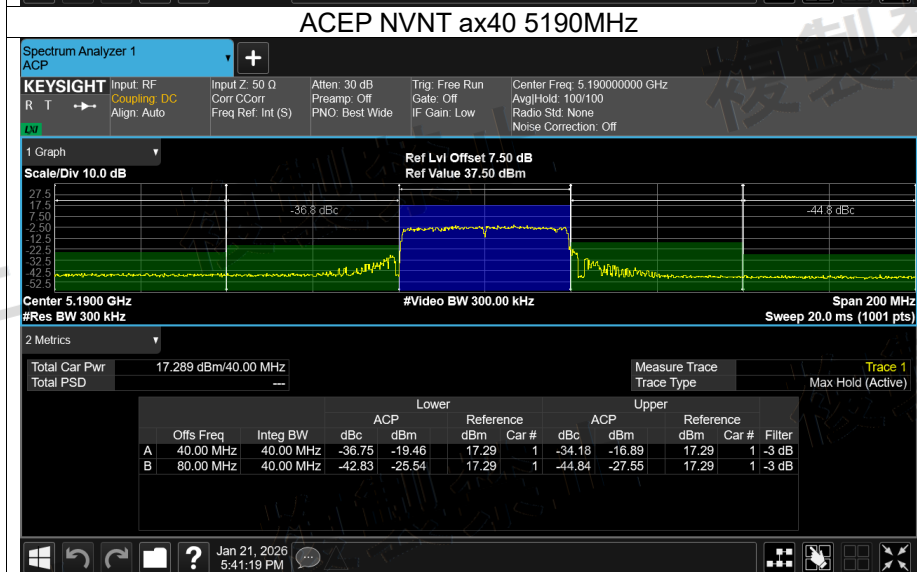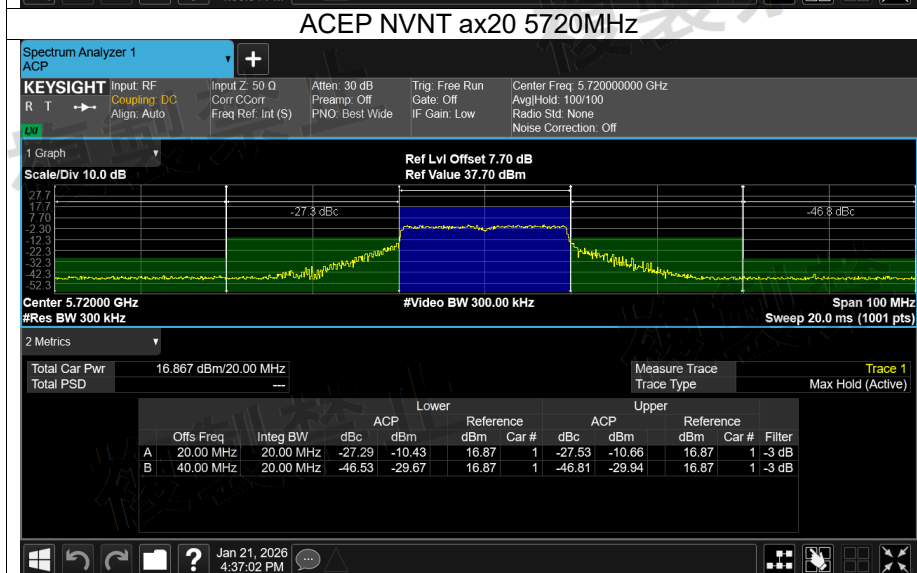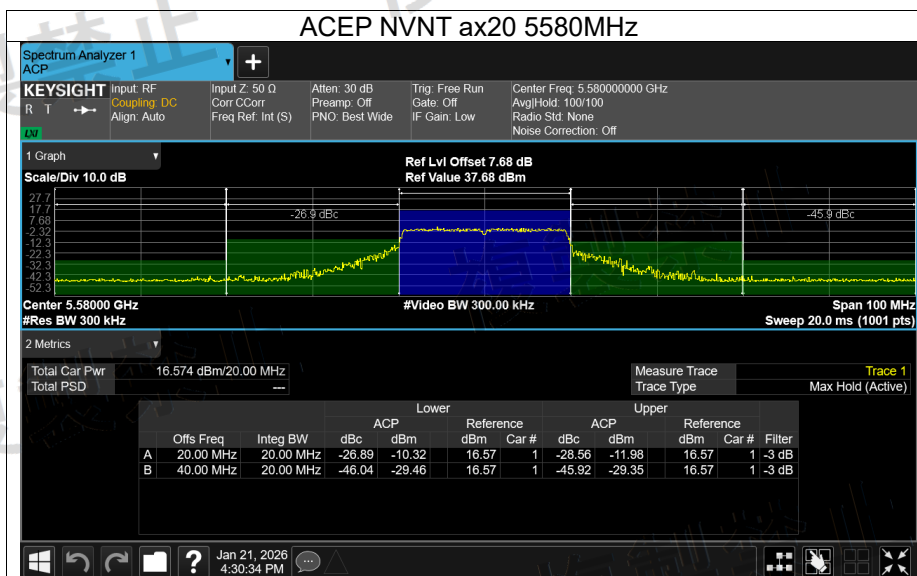

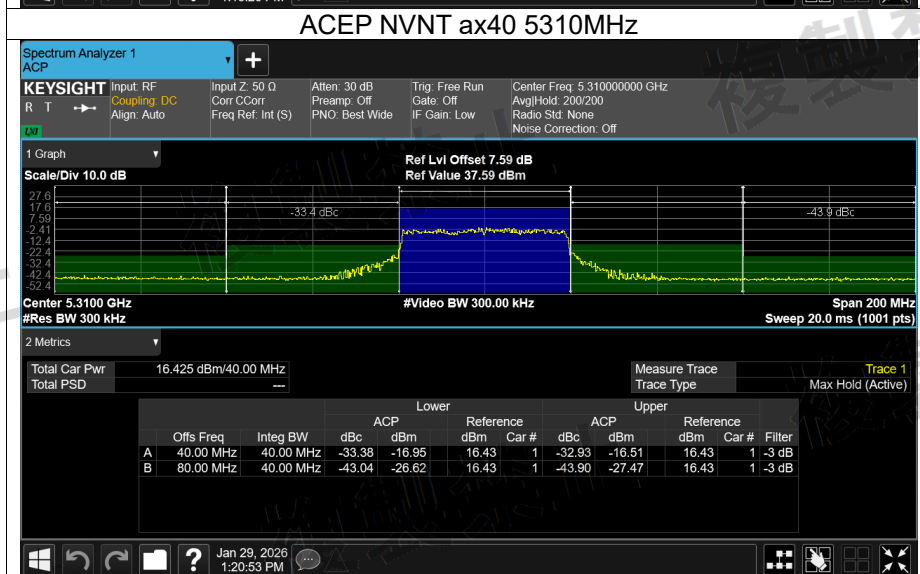
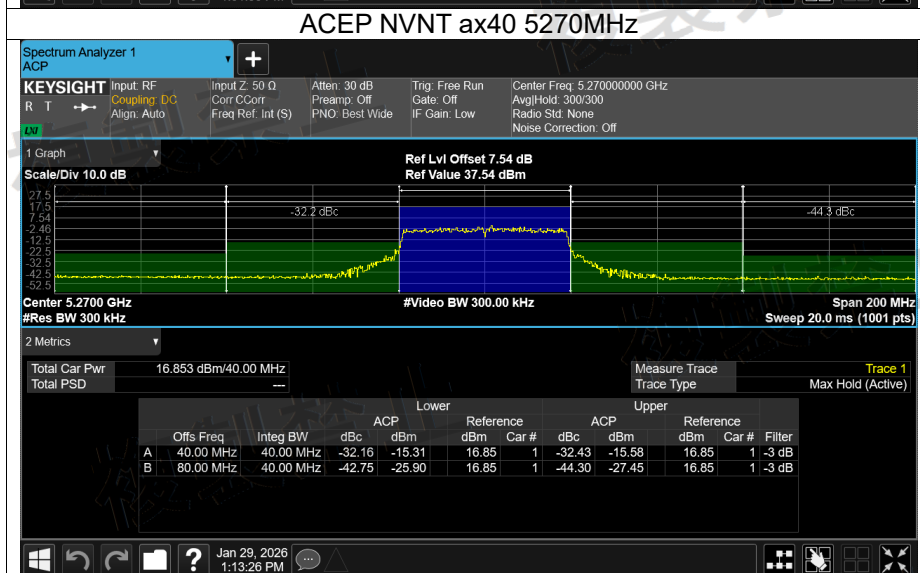
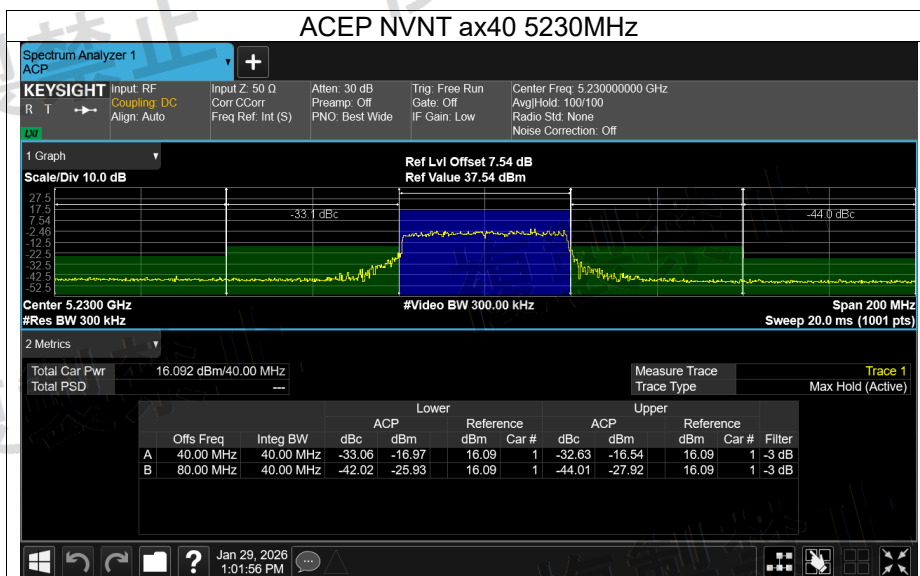


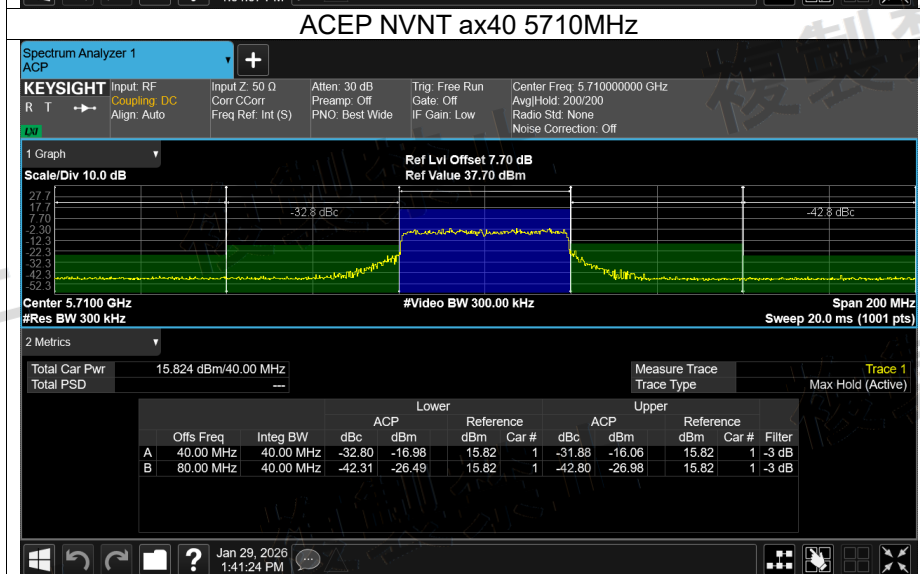
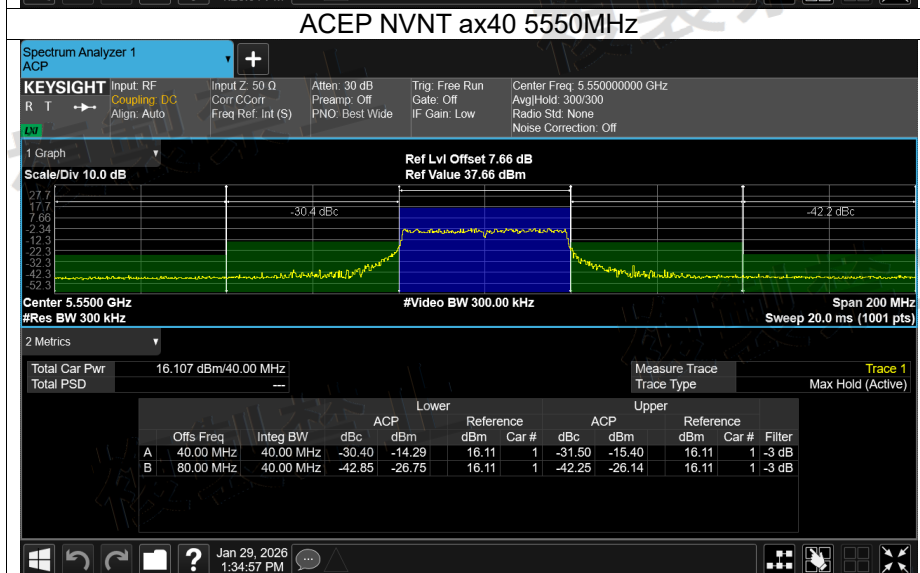
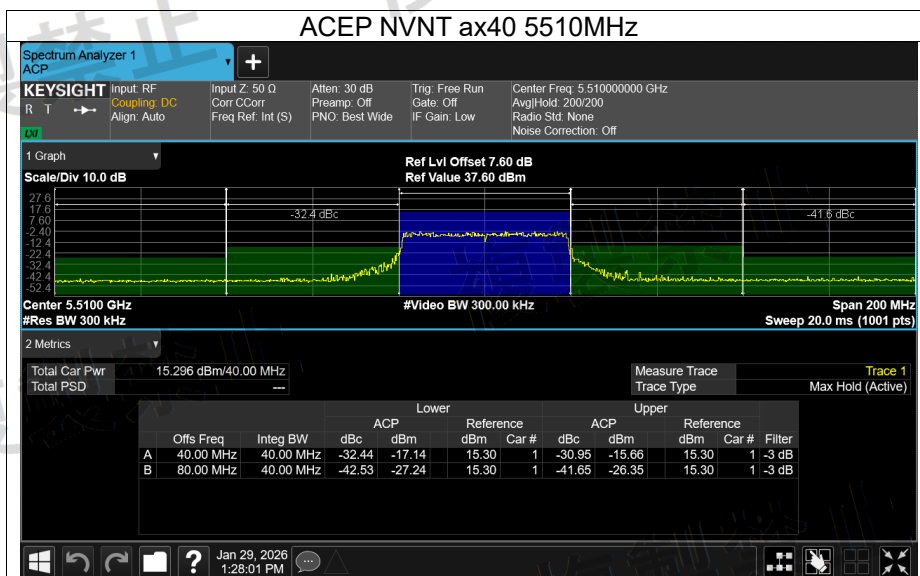










CARRIER SENSE




Condition	Mode	Frequency (MHz)	Verdict
NVNT	n40	5190	Pass
NVNT	n40	5230	Pass
NVNT	n40	5270	Pass
NVNT	n40	5310	Pass
NVNT	n40	5510	Pass
NVNT	n40	5550	Pass
NVNT	n40	5710	Pass
NVNT	ac40	5190	Pass
NVNT	ac40	5230	Pass
NVNT	ac40	5270	Pass
NVNT	ac40	5310	Pass
NVNT	ac40	5510	Pass
NVNT	ac40	5550	Pass
NVNT	ac40	5710	Pass
NVNT	ax40	5190	Pass
NVNT	ax40	5230	Pass
NVNT	ax40	5270	Pass
NVNT	ax40	5310	Pass
NVNT	ax40	5510	Pass
NVNT	ax40	5550	Pass
NVNT	ax40	5710	Pass

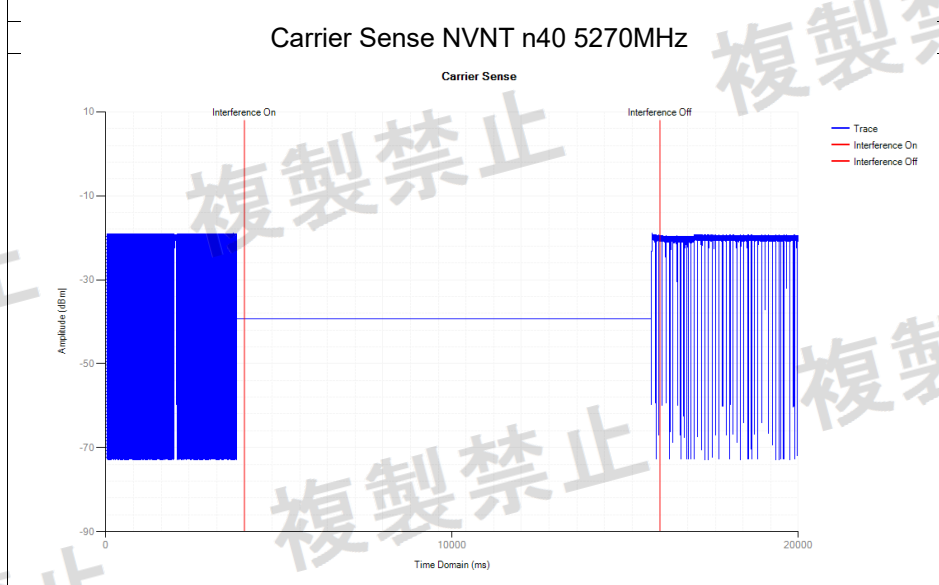
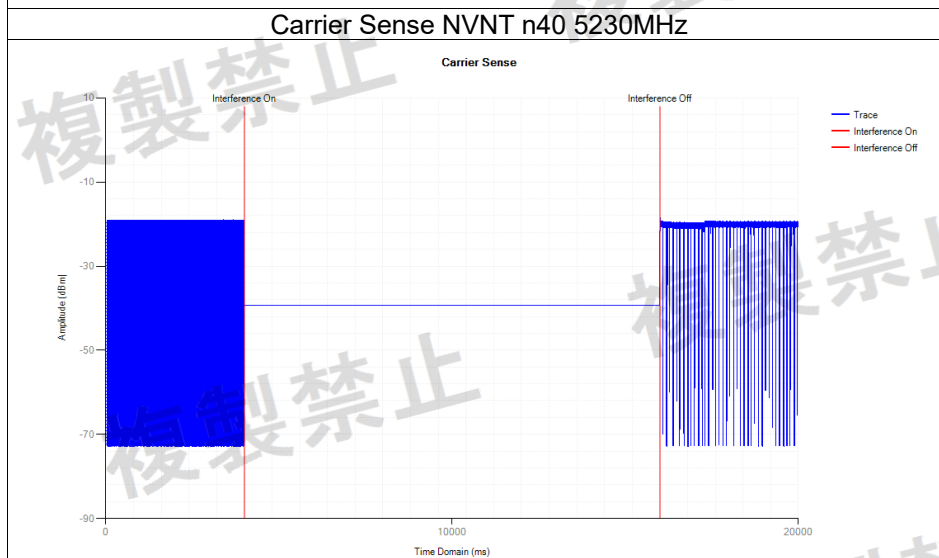
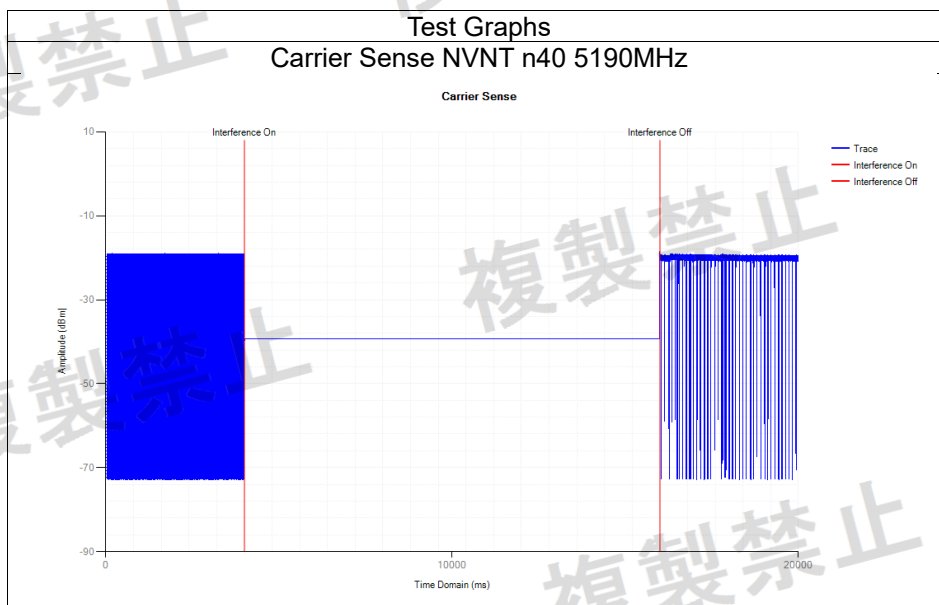


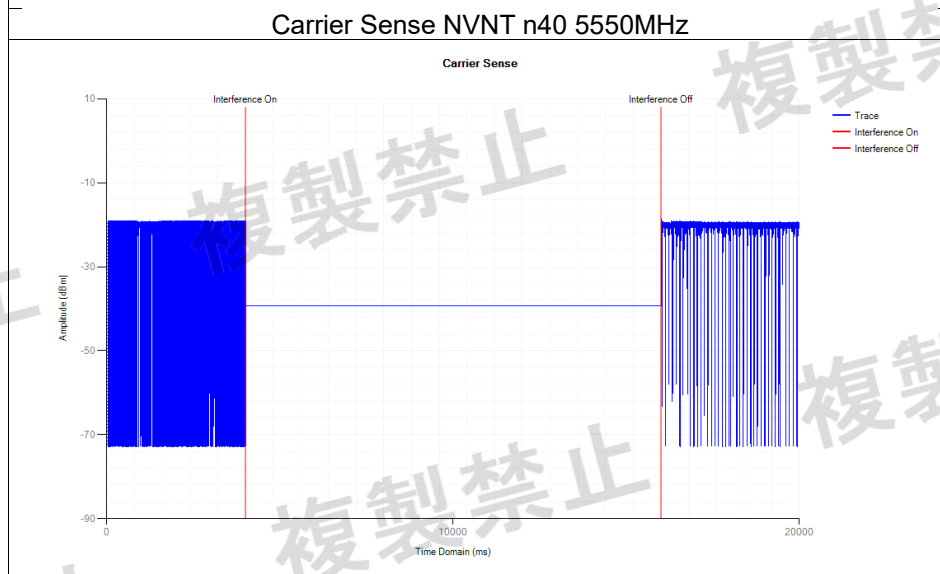
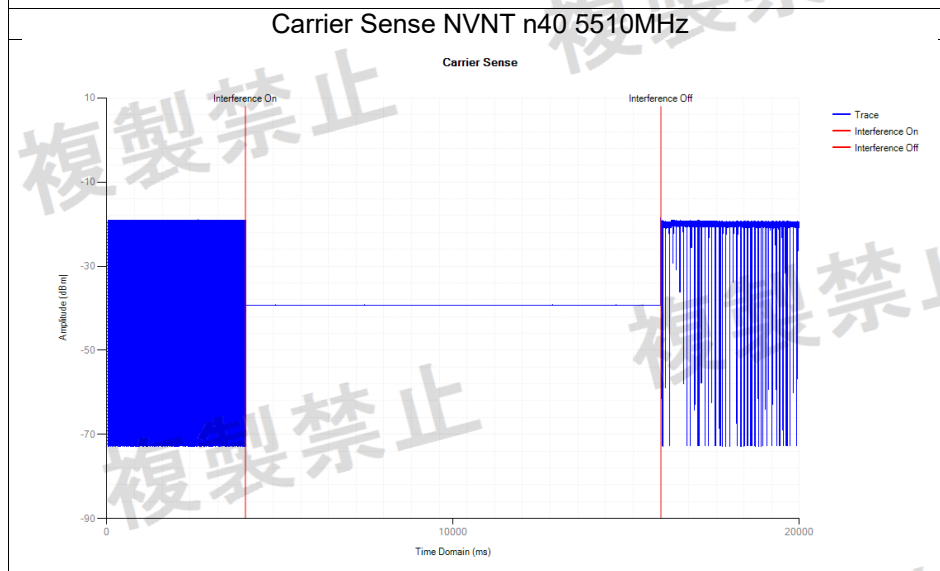
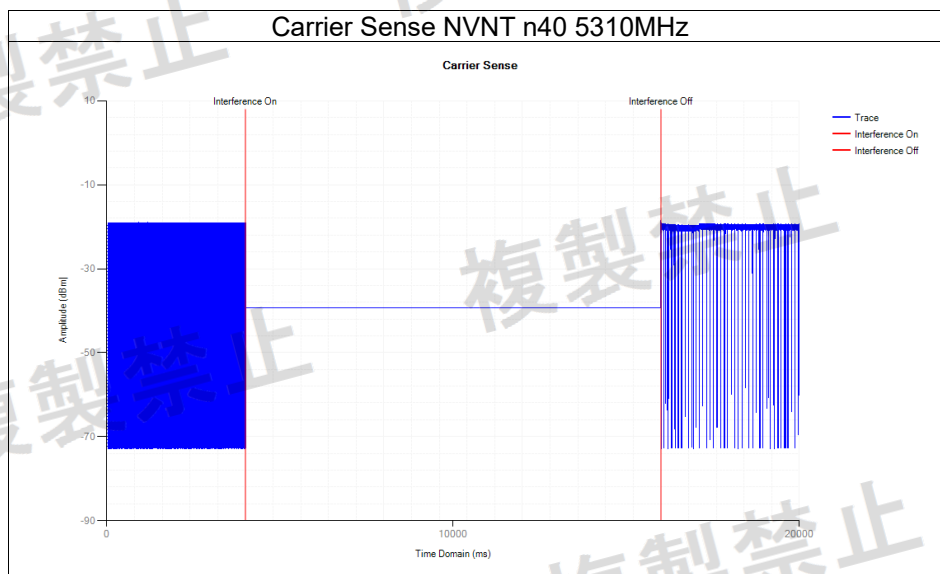


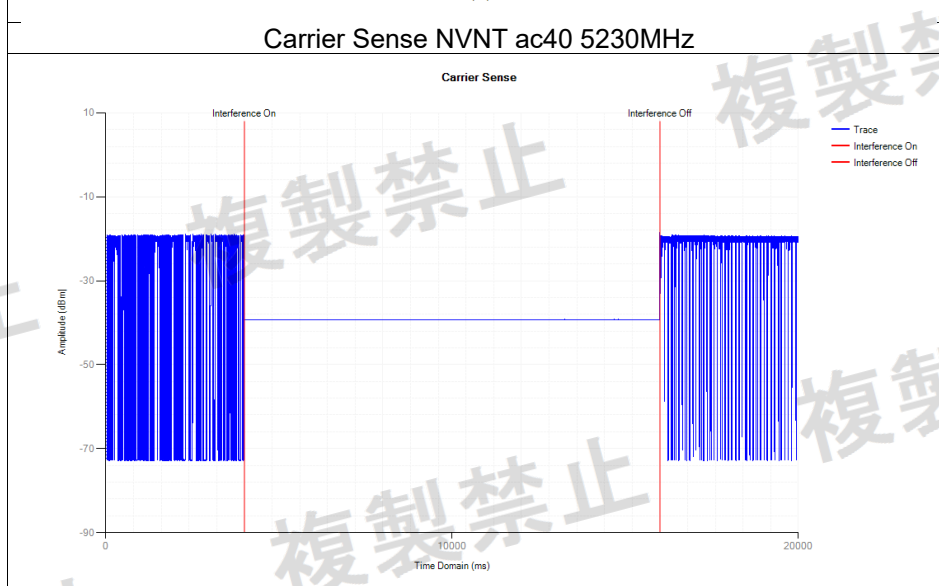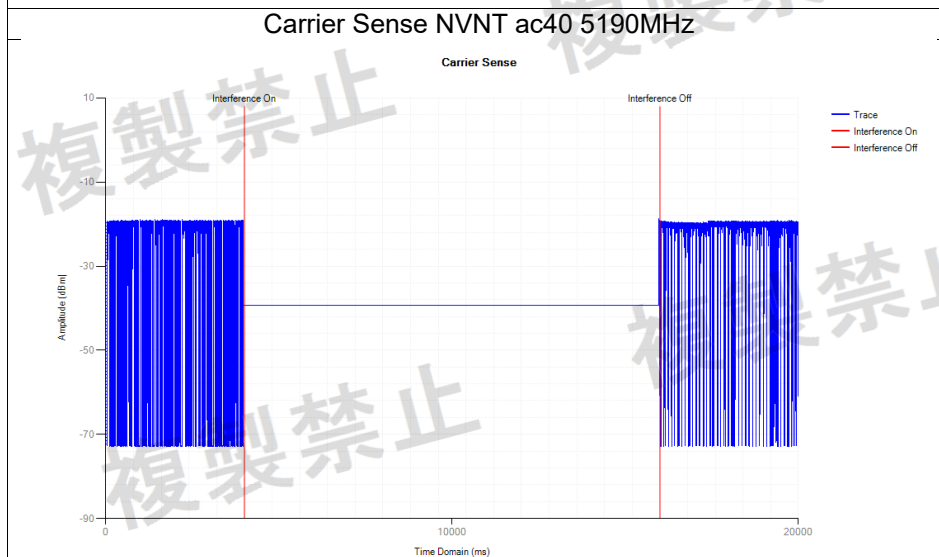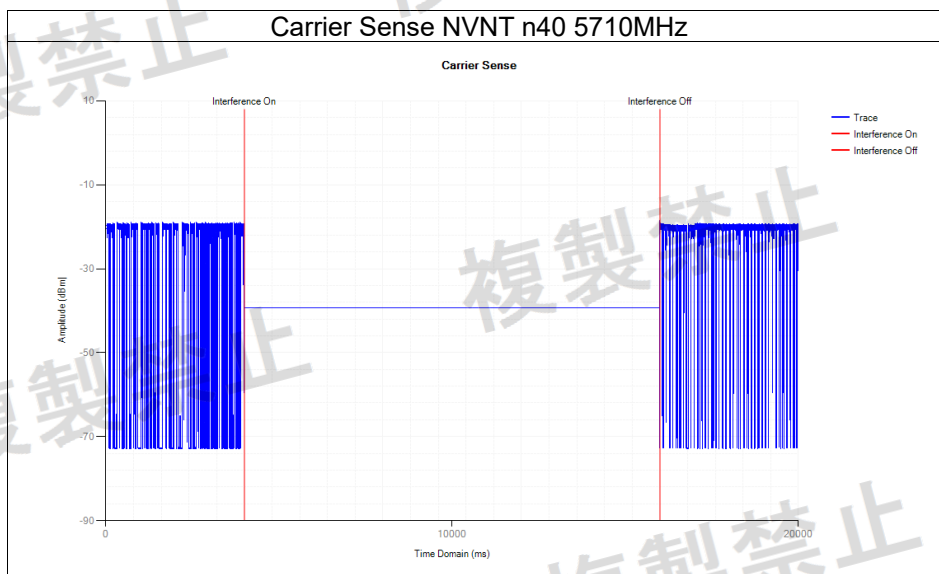

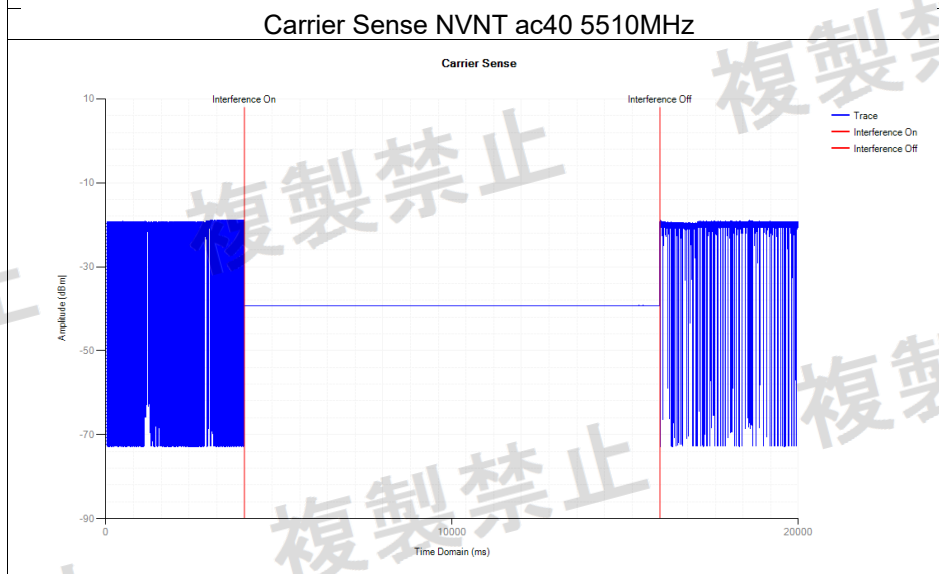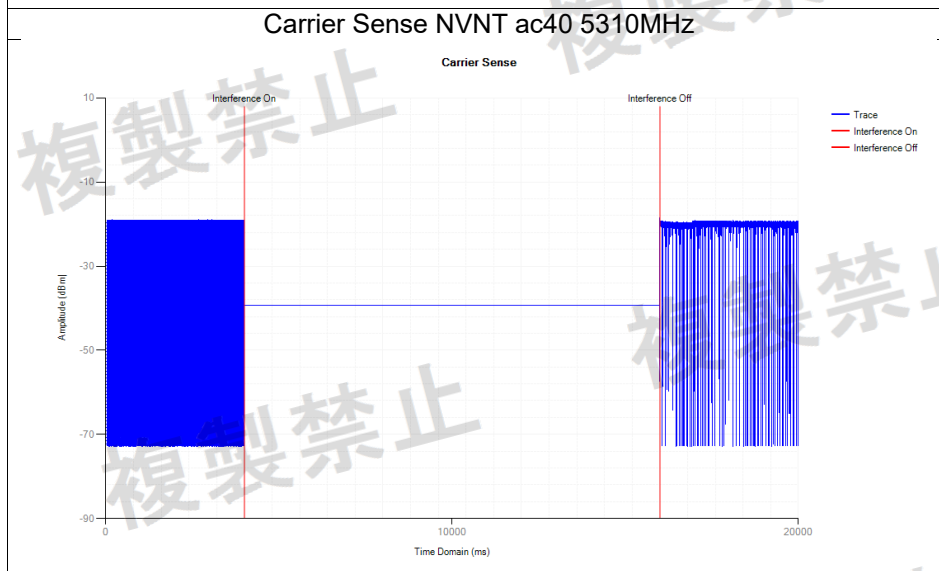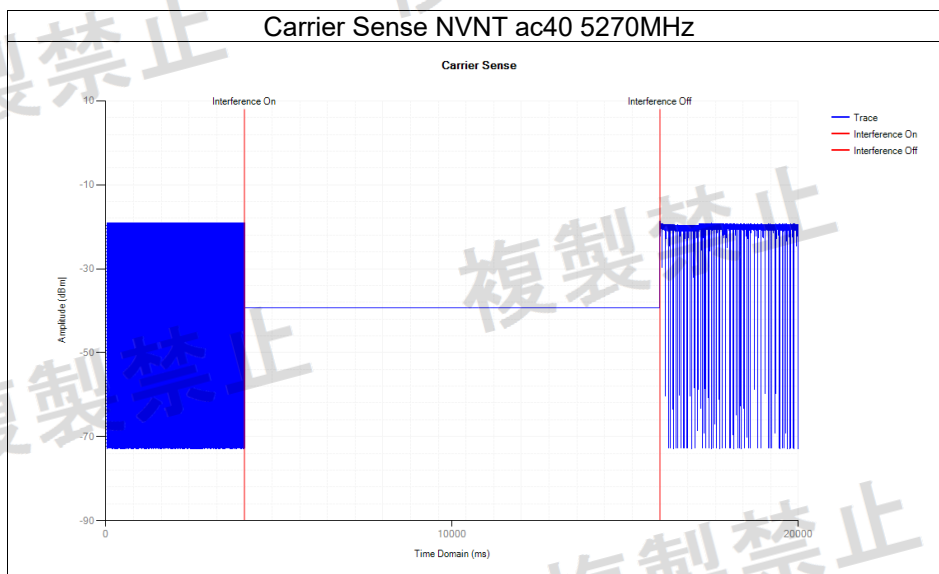

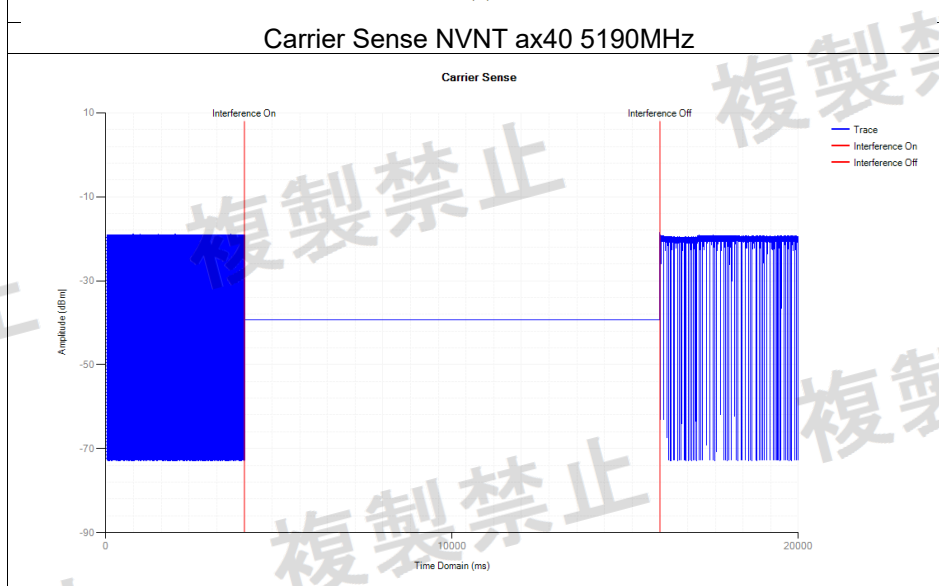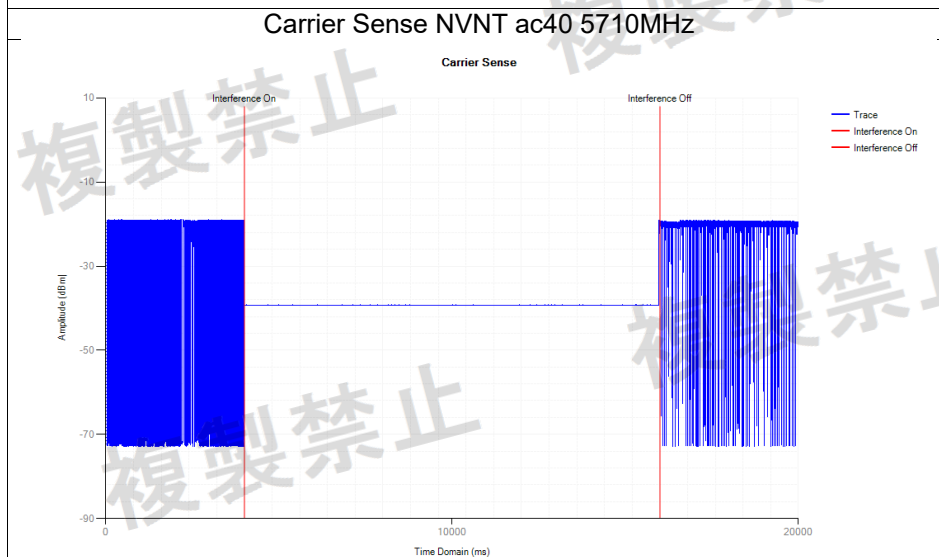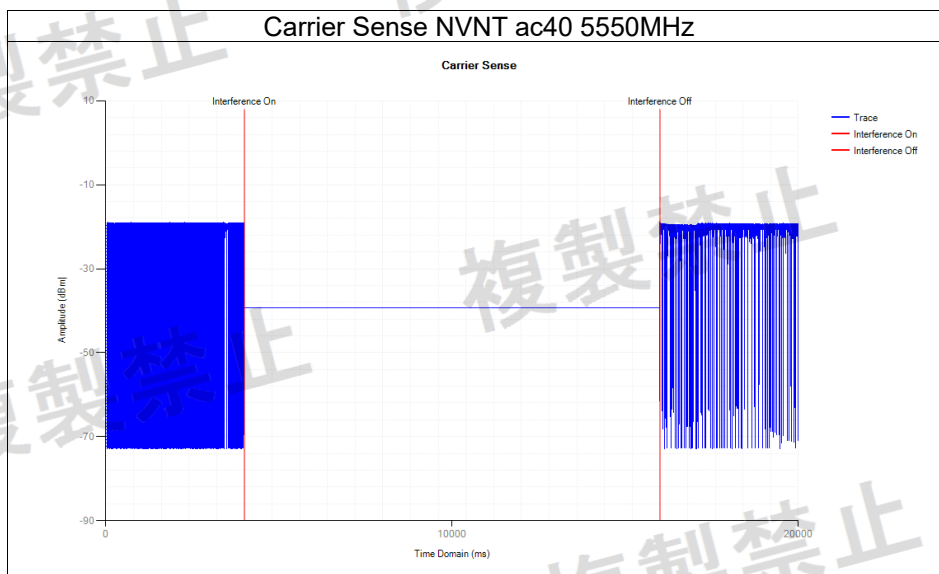

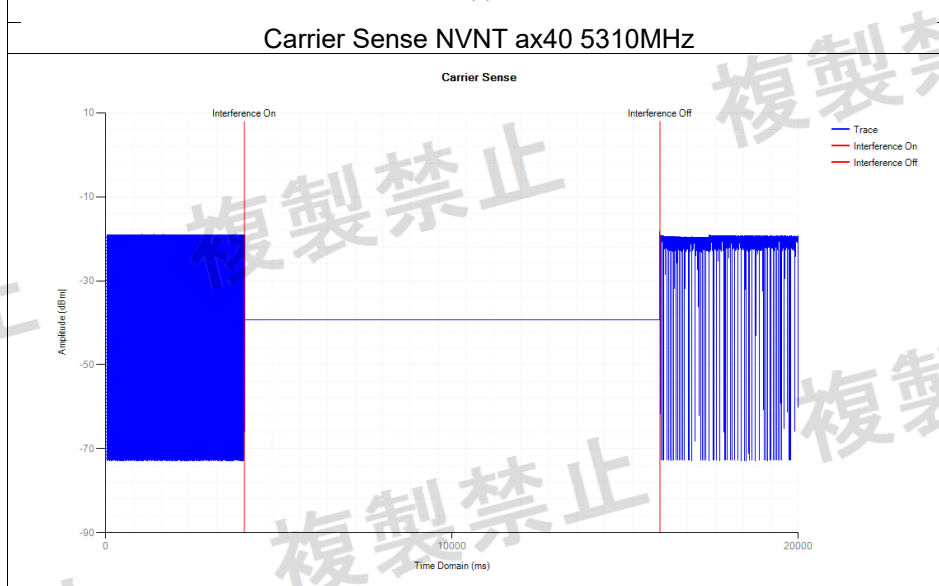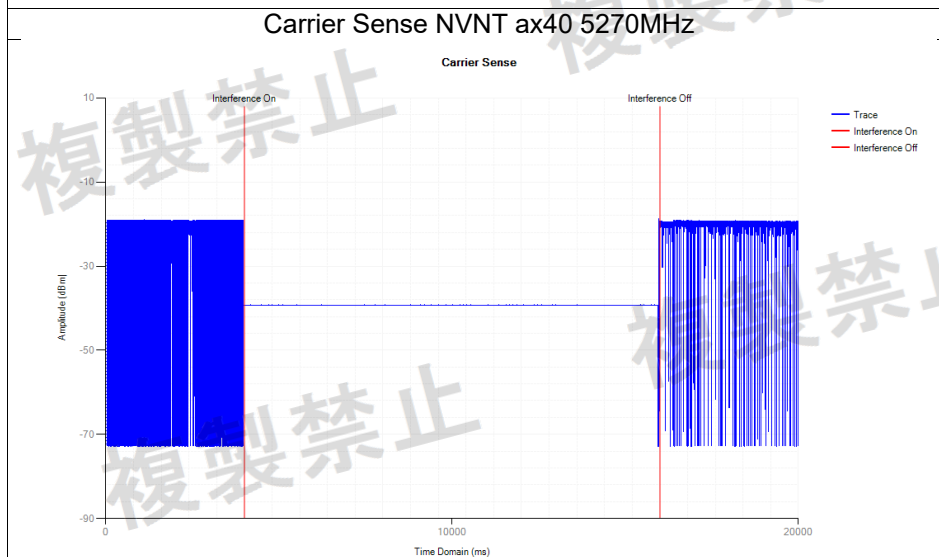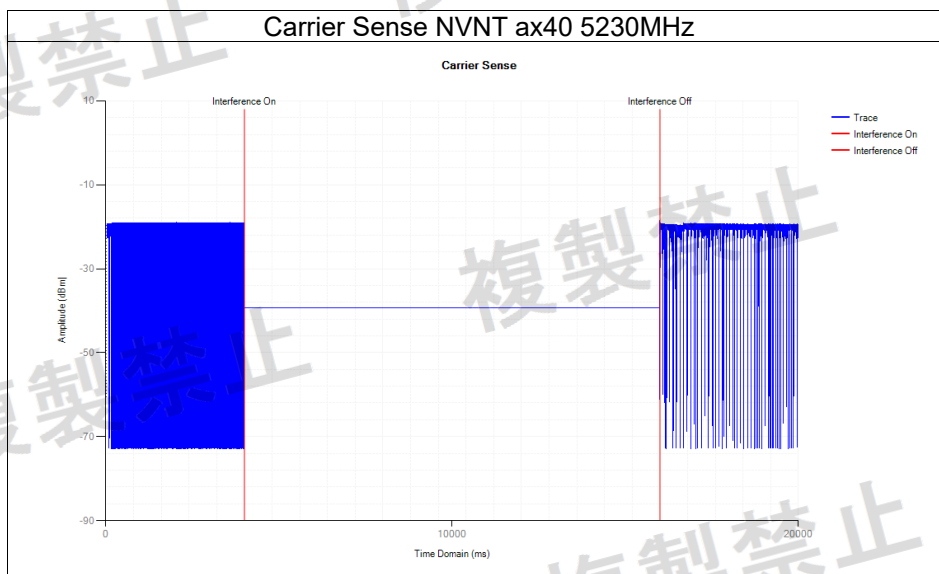

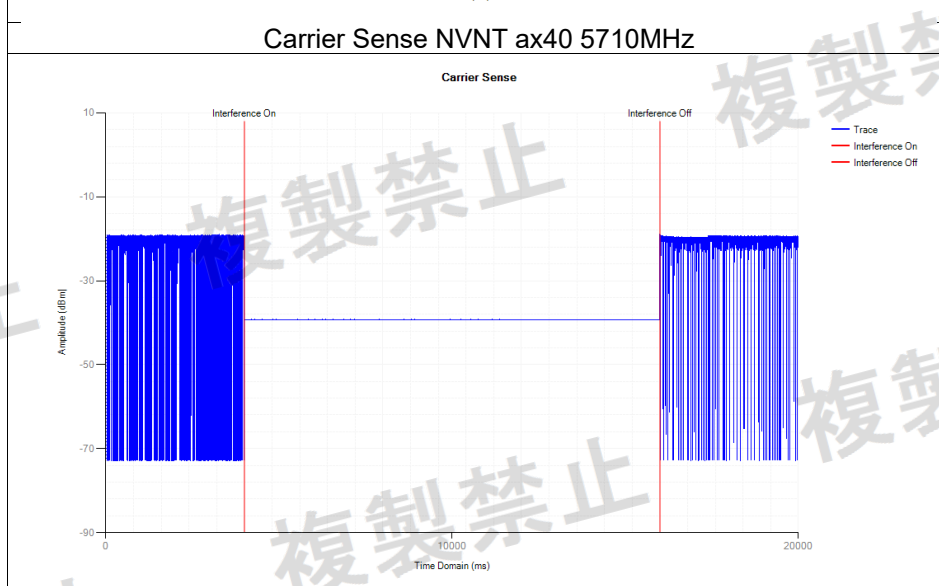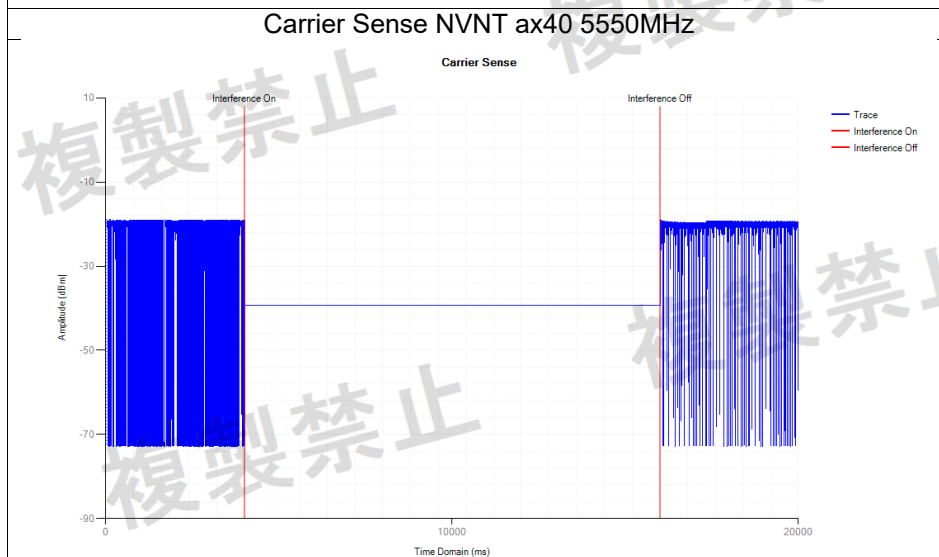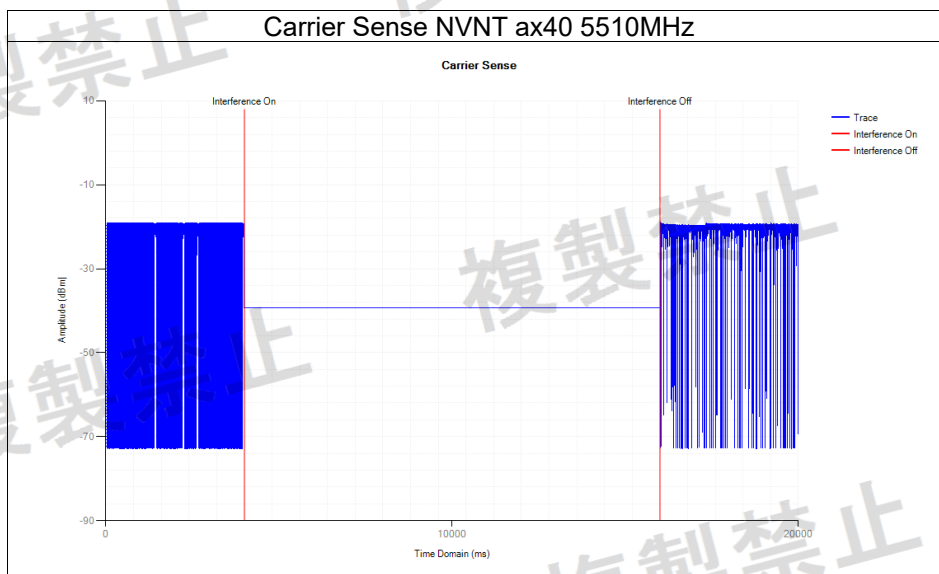



APPENDIX II - TEST SETUP PHOTOS





APPENDIX III - PHOTOGRAPHS OF EUT CONSTRUCTIONAL DETAILS

Note: Please see the attached DBDLP116_EUT Photos.

※※※※※END OF THE REPORT※※※※※