
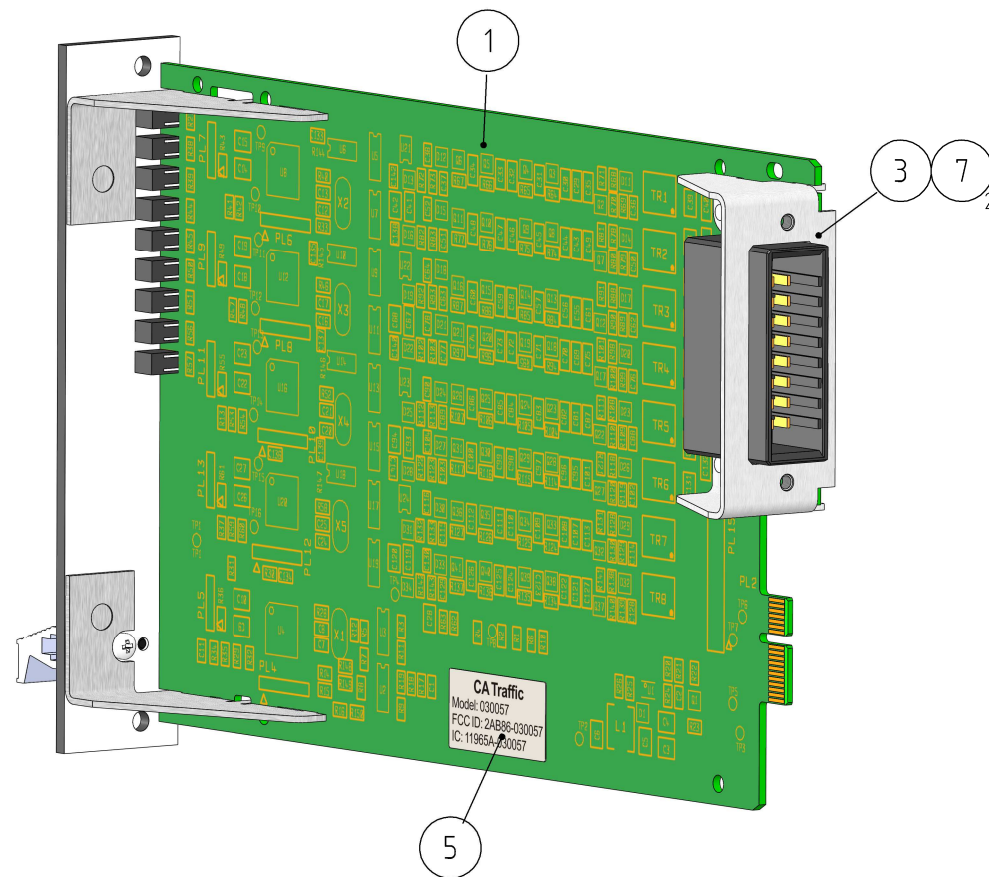


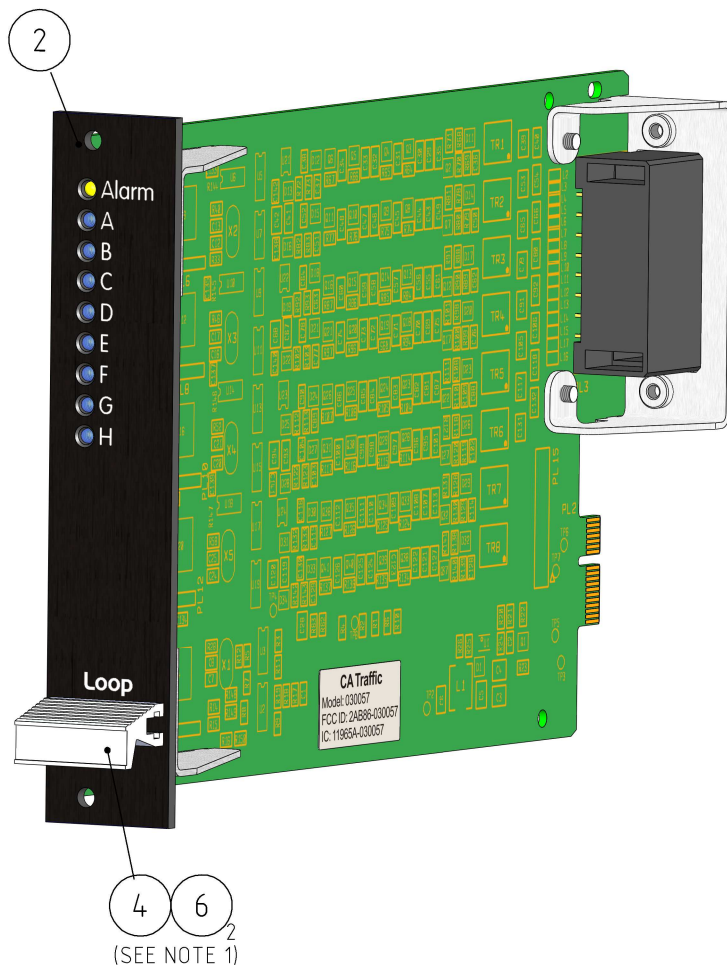

NOTES-

- ENSURE THAT HANDLE ITEM (4) IS FITTED SQUARELY ONTO FRONT PANEL ITEM (2) USING FIXTURE 040156 (*Fixture, Handle, Card Assembly*) AND TIGHTEN SCREWS TO A TORQUE OF 120cNm

ITEM NO.	QTY	PART NUMBER	DESCRIPTION
1	1	020104	Pcb Assembly, Loop Detector
2	1	040104	Front Panel, Loop Detector, Pcb Assembly
3	1	040126	Bracket, Rear, Tyco/JST Connector
4	1	050360	Handle Extrusion 24±0.2mm Schroff
5	1	070145	Label, FCC-IC, Loop Detector
6	1	060022	Screw M2.5x6 Cross Recess Pan Hd ISO 7045
7	2	060158	Screw M3x5 Cross Recess Pan Hd ISO 7045

TOLERANCES NO DECIMAL PLACE ±0.5mm 1 DECIMAL PLACE ±0.2mm 2 DECIMAL PLACES ±0.1mm Unless otherwise stated This drawing/specification is the property of CA TRAFFIC LTD and may not be reproduced or disclosed to a third party in any form without the written permission of the company	ISS	DATE	ECR	INIT	CHK	APR	DETAILS OF CHANGE		DRAWN BY	DO NOT SCALE	DIMENSIONS ARE IN MILLIMETRES  Griffin Lane, Aylesbury, Buckinghamshire, P19 8BP Fax: 01296 333499 Tel: 01296 333499	MATERIAL	SCALE
	02	10-7-14	258	DH	CS	MA	Label item 5 added		D.Hoyes			FINISH	1:1
									CHECKED			DATE	18 Dec 08
									APPROVED			TITLE	DRG.No.
												Card Assembly, Loop Detector (Rack)	030057