



n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.54dBm

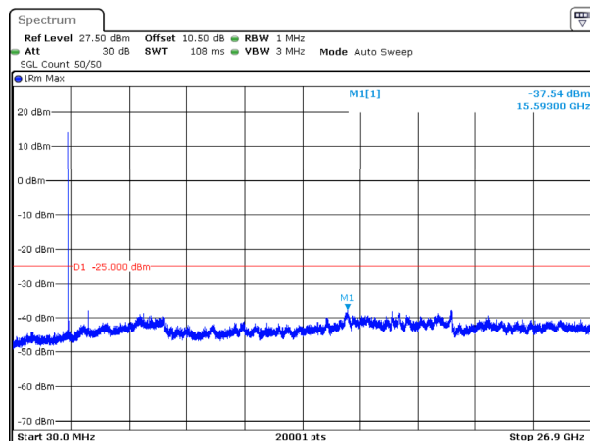


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:00:15

n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@37 -37.63dBm

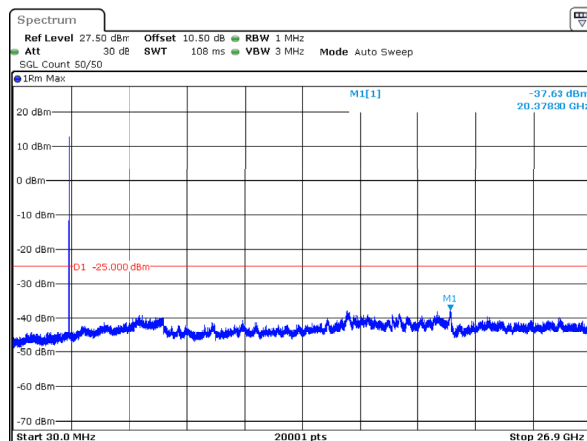


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:00:54

n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB36@0 -37.67dBm

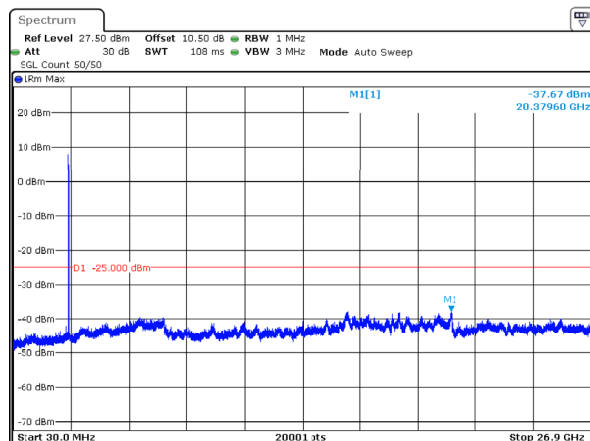


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:01:33

n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM
QPSK_RB1@0 -37.67dBm

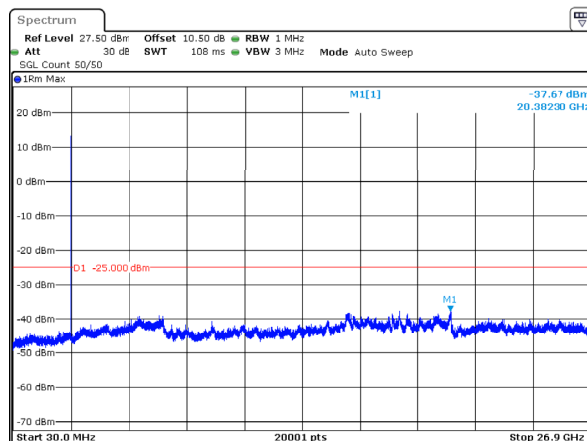


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:03:04

n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM
QPSK_RB1@37 -36.89dBm

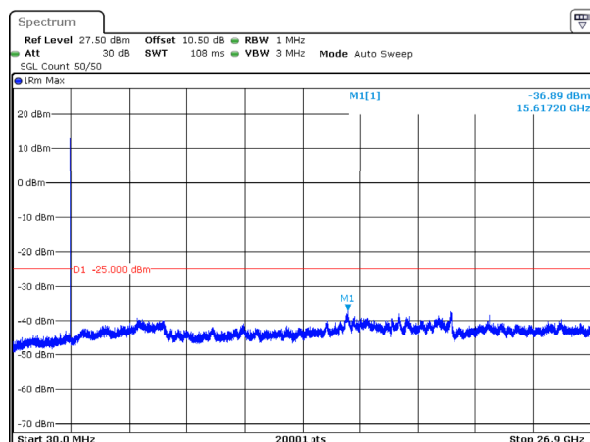


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:03:43

n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM
QPSK_RB36@0 -37.03dBm

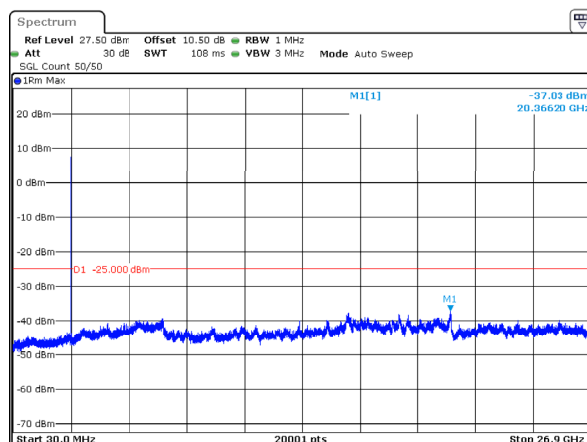


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:04:22

n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM
QPSK_RB1@0 -37.40dBm

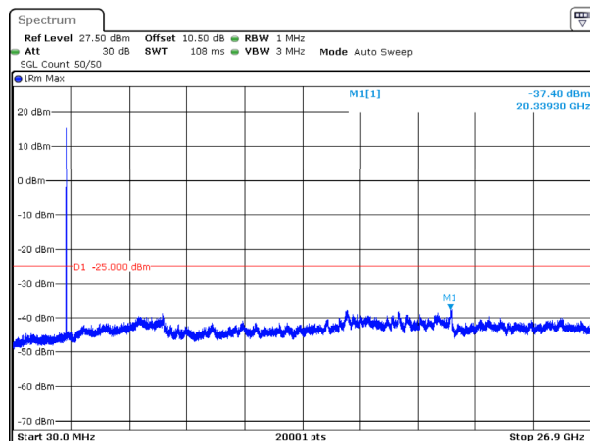


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:05:28

n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM
QPSK_RB1@50 -37.72dBm

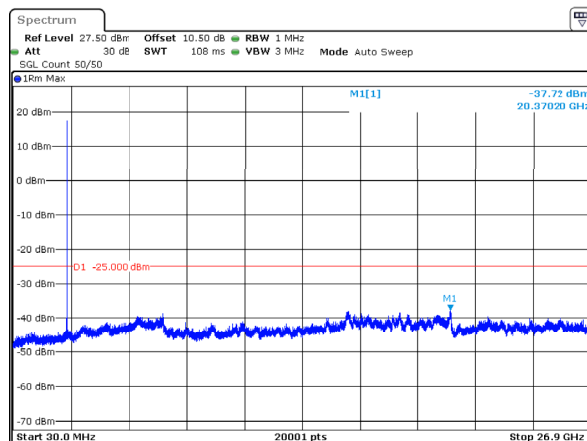


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:06:07

n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM
QPSK_RB50@0 -34.67dBm

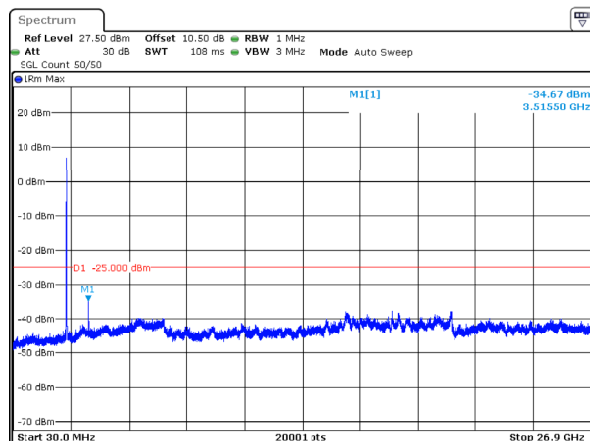


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:06:46

n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.06dBm

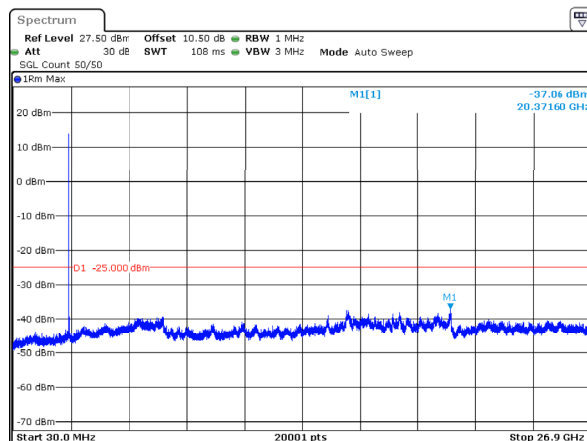


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:08:34

n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@50 -37.30dBm

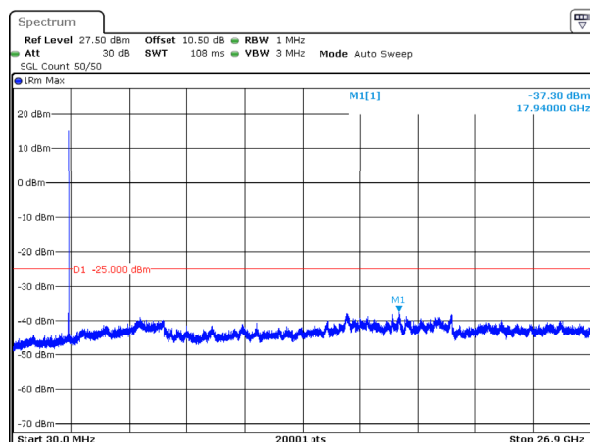


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:09:14

n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB50@0 -37.45dBm

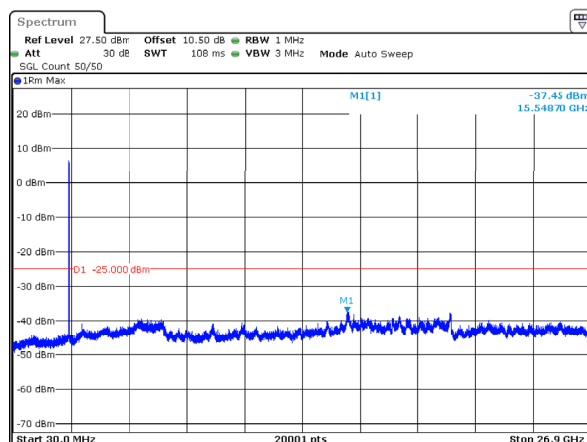


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:09:52

n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.10dBm

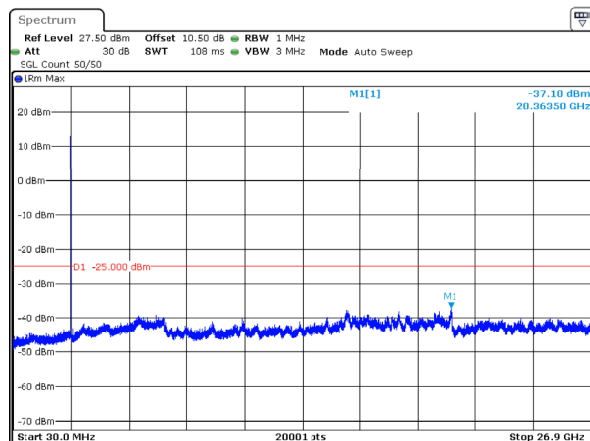


ProjectNo.:2401W26164E-RF Tester:Kungfumastr Liang
Date: 11.SEP.2024 16:11:12

n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM
QPSK_RB1@50 -37.11dBm

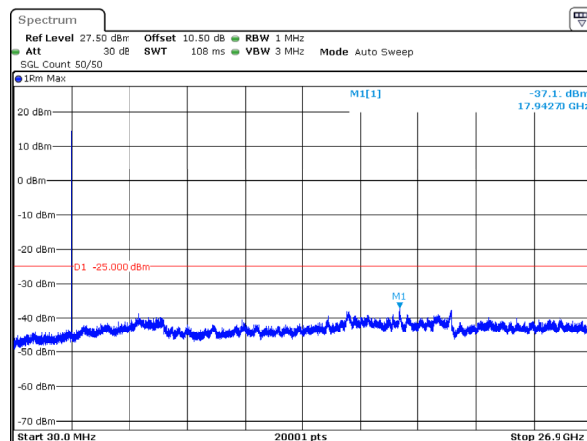


ProjectNo.:2401W26164E-RF Tester:Kungfumastr Liang
Date: 11.SEP.2024 16:11:51

n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM
QPSK_RB50@0 -37.47dBm

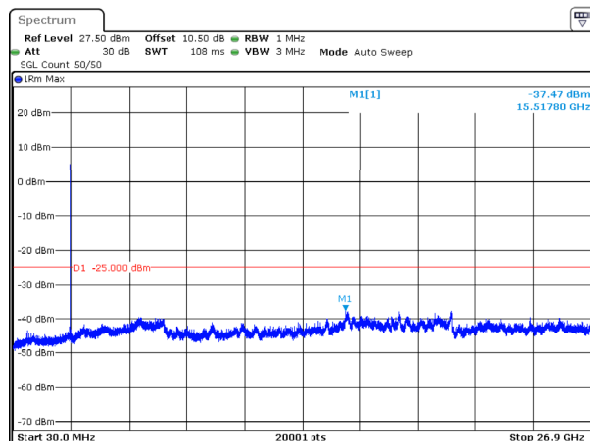


ProjectNo.:2401W26164E-RF Tester:Kungfumastr Liang
Date: 11.SEP.2024 16:12:30

n41_30MHz_30kHz_2511MHz_DFT-s-OFDM
QPSK_RB1@0 -37.04dBm

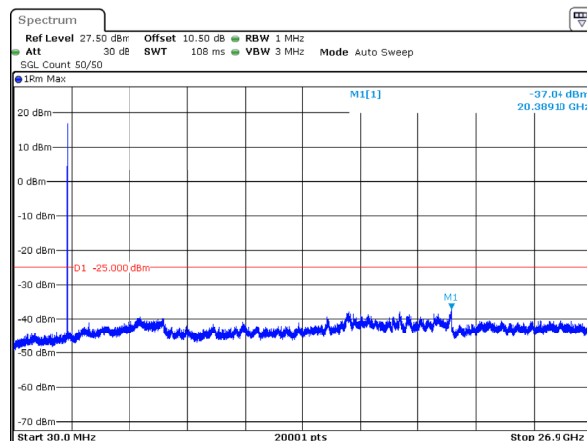


ProjectNo.:2401W26164E-RF Tester:Kungfumastr Liang
Date: 11.SEP.2024 16:13:51

n41_30MHz_30kHz_2511MHz_DFT-s-OFDM
QPSK_RB1@77 -37.33dBm

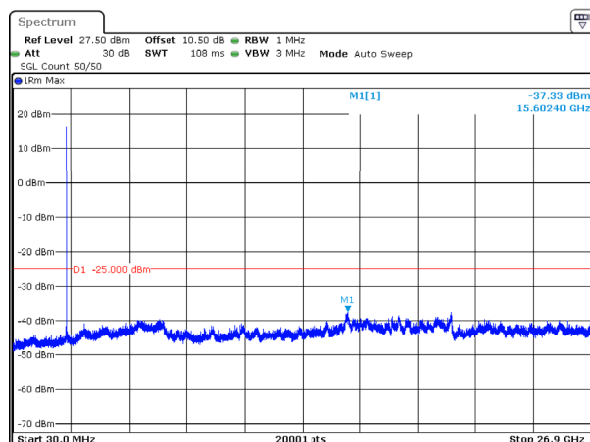


ProjectNo.:2401W26164E-RF Tester:Kungfumastr Liang
Date: 11.SEP.2024 16:14:31

n41_30MHz_30kHz_2511MHz_DFT-s-OFDM
QPSK_RB75@0 -37.79dBm

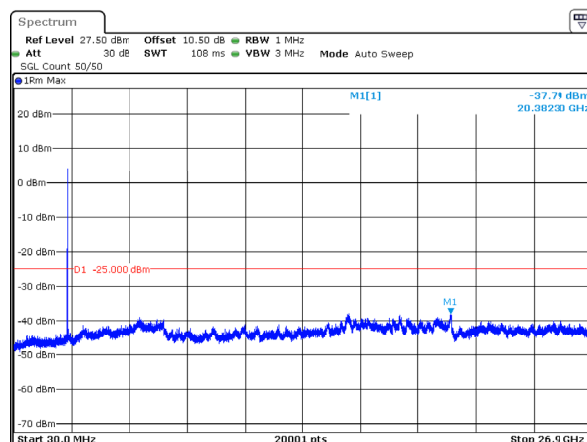


ProjectNo.:2401W26164E-RF Tester:Kungfumastr Liang
Date: 11.SEP.2024 16:15:10

n41_30MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.44dBm

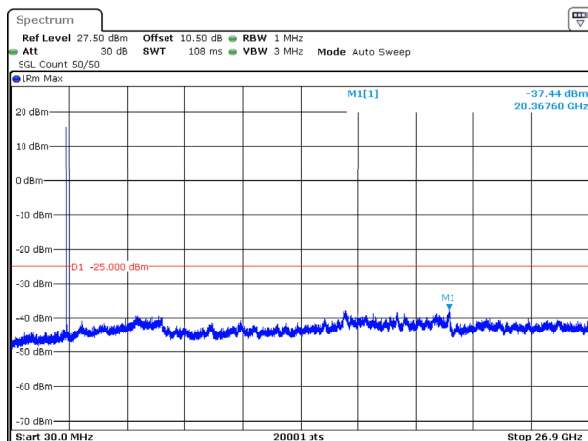


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:16:57

n41_30MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@77 -37.39dBm

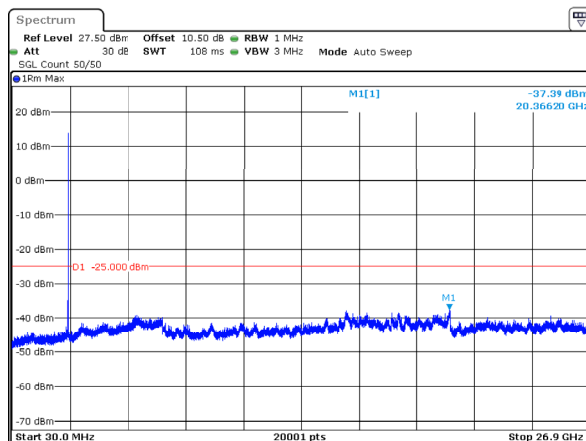


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:17:37

n41_30MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB75@0 -37.27dBm

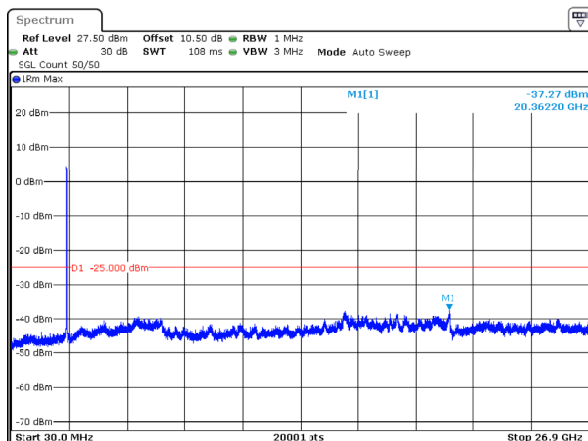


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:18:17

n41_30MHz_30kHz_2674.98MHz_DFT-s-OFDM
QPSK_RB1@0 -36.22dBm

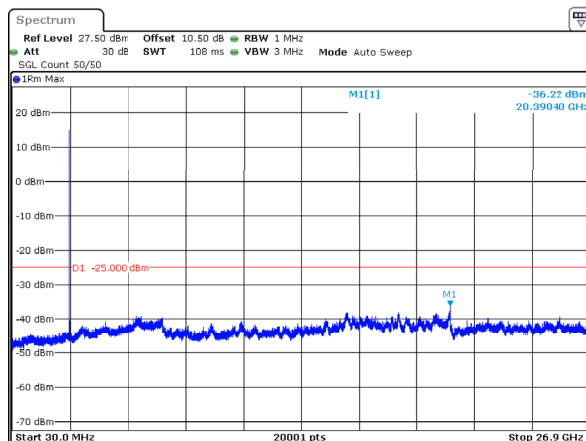


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:20:08

n41_30MHz_30kHz_2674.98MHz_DFT-s-OFDM
QPSK_RB1@77 -37.79dBm

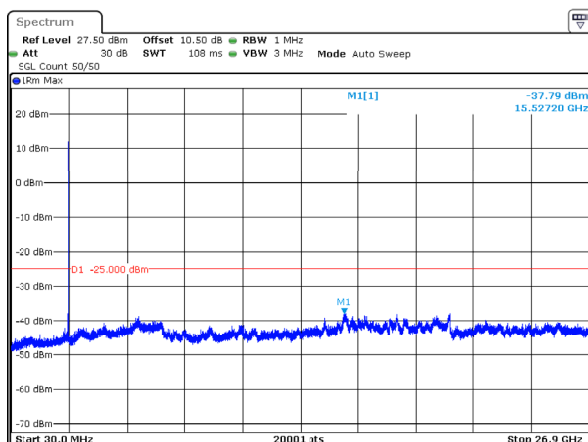


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:20:47

n41_30MHz_30kHz_2674.98MHz_DFT-s-OFDM
QPSK_RB75@0 -37.65dBm

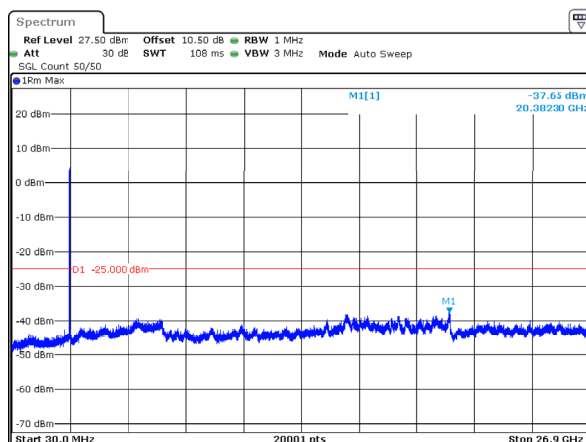


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:21:26

n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM
QPSK_RB100@0 -37.66dBm

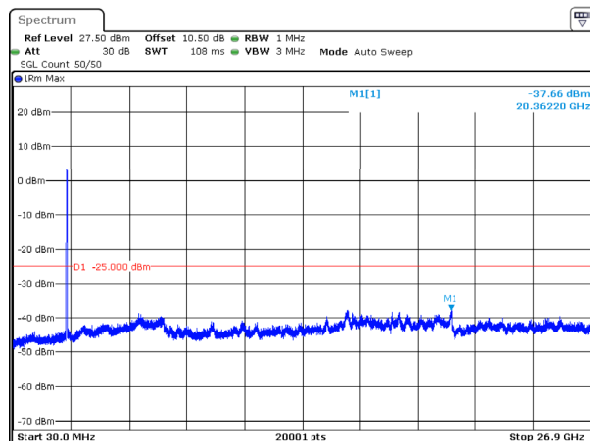


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:24:07

n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM
QPSK_RB1@0 -37.42dBm

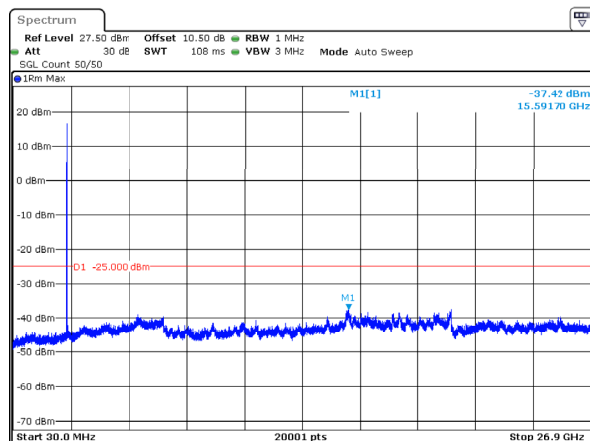


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:22:47

n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM
QPSK_RB1@105 -37.03dBm

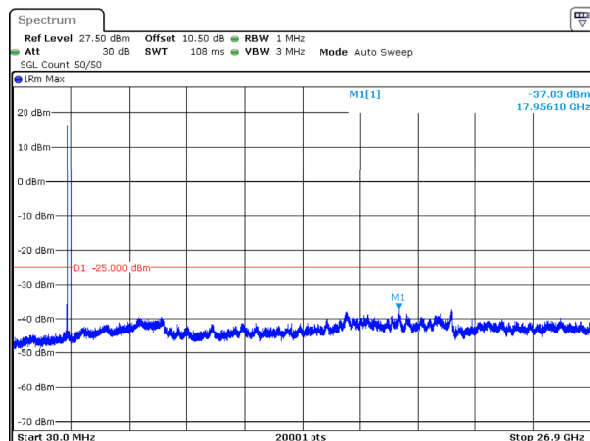


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:23:27

n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB100@0 -37.15dBm

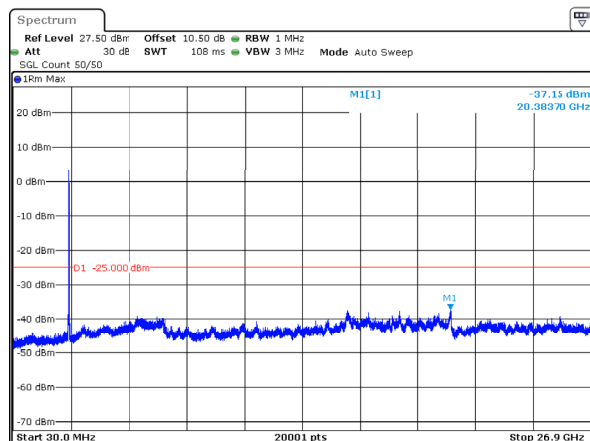


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:26:51

n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -35.91dBm

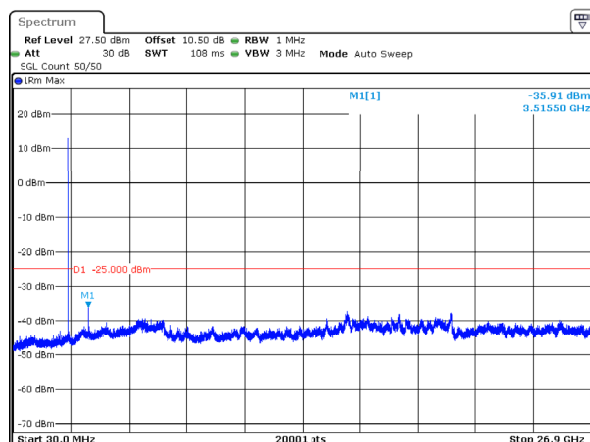


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:25:30

n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@105 -36.91dBm

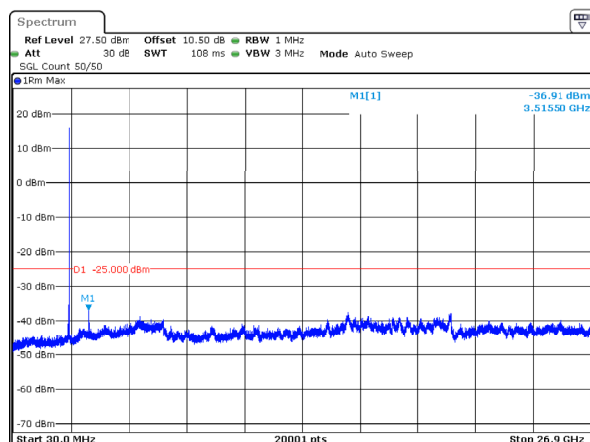


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:26:12


n41_40MHz_30kHz_2670MHz_DFT-s-OFDM
QPSK_RB100@0 -37.50dBm

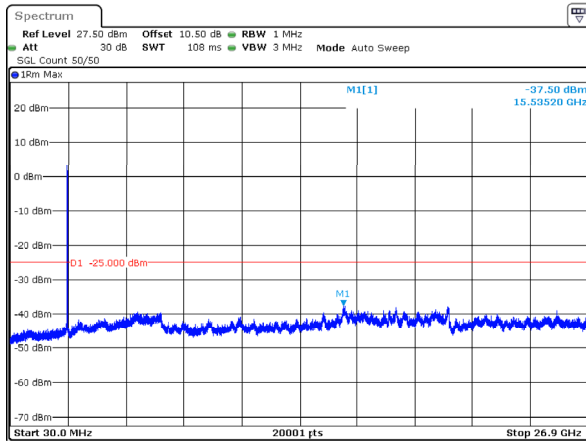


n41_40MHz_30kHz_2670MHz_DFT-s-OFDM
QPSK_RB1@0 -37.52dBm

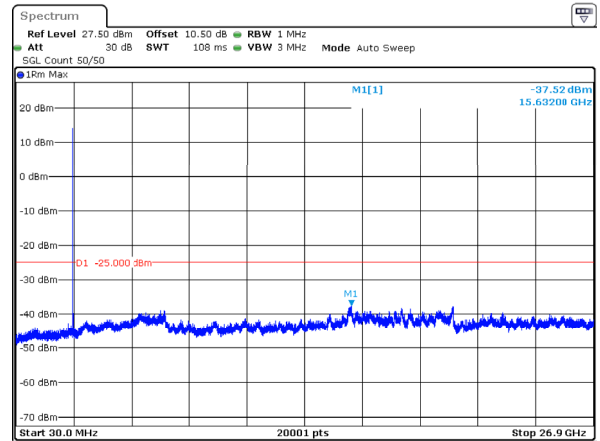


n41_40MHz_30kHz_2670MHz_DFT-s-OFDM
QPSK_RB1@105 -37.66dBm

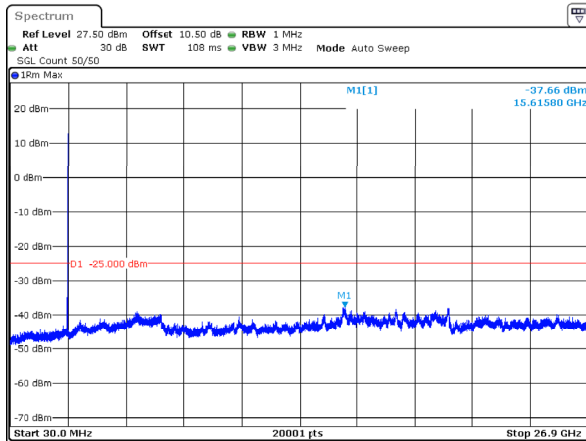


n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM
QPSK_RB128@0 -37.73dBm

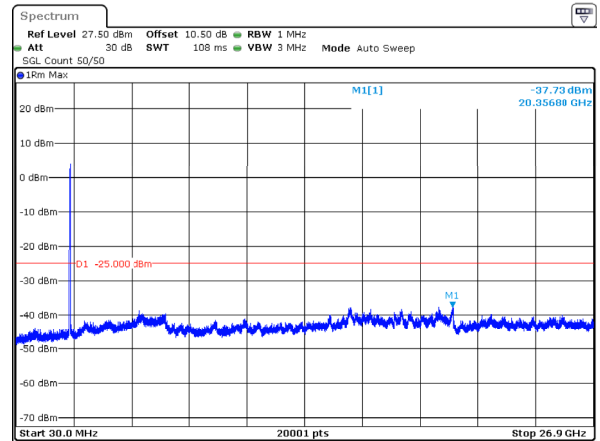


n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM
QPSK_RB1@0 -37.46dBm

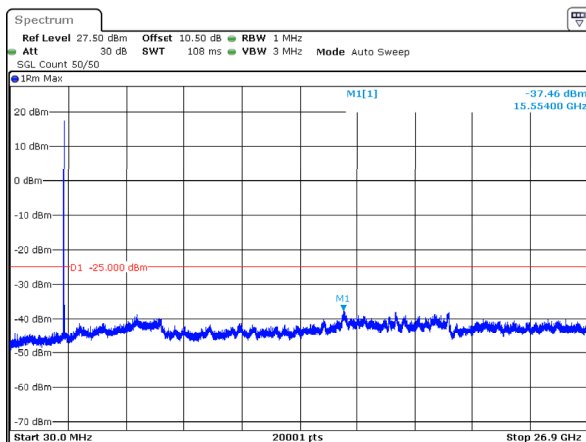

n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM
QPSK_RB1@132 -36.20dBm

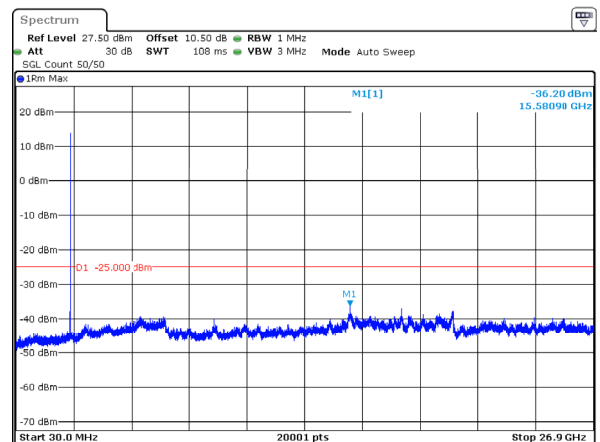


n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB128@0 -37.46dBm

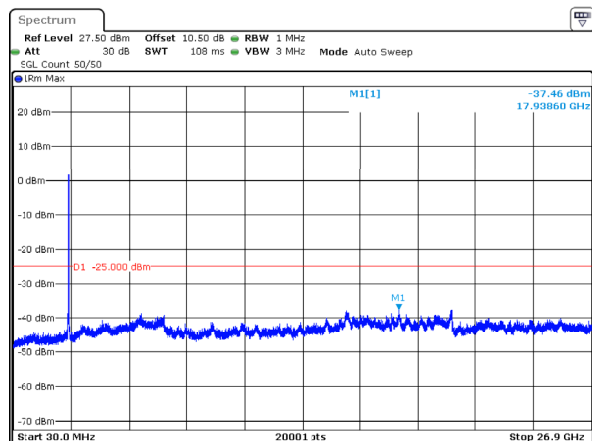


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:34:23

n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -36.86dBm

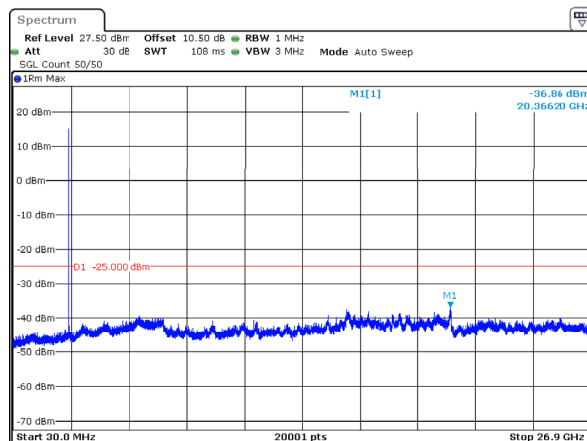


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:33:03

n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@132 -36.95dBm

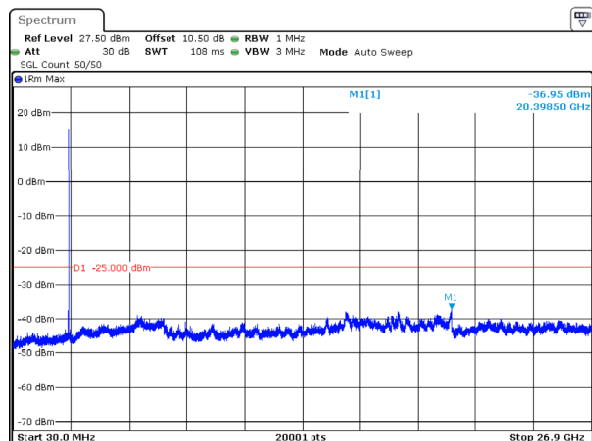


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:33:43

n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM
QPSK_RB128@0 -36.73dBm

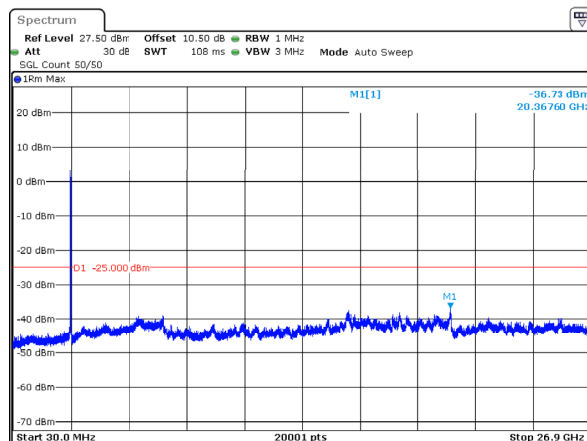


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:37:30

n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.61dBm

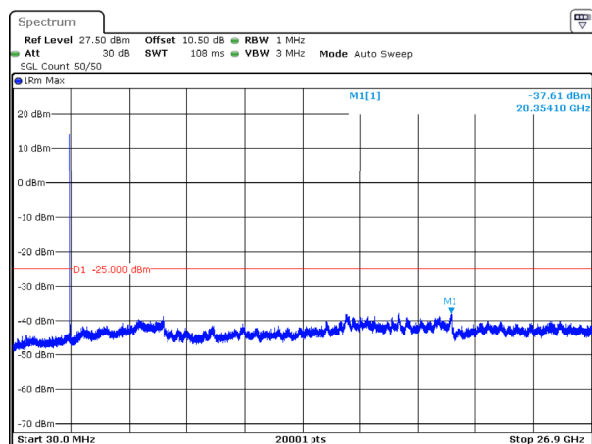


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:36:11

n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM
QPSK_RB1@132 -36.89dBm

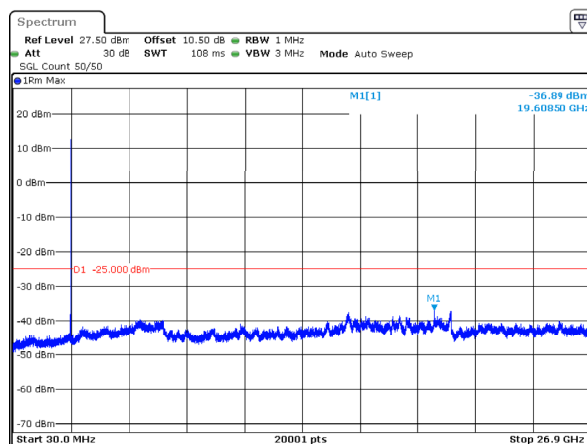


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:36:50

n41_60MHz_30kHz_2526MHz_DFT-s-OFDM
QPSK_RB162@0 -37.45dBm

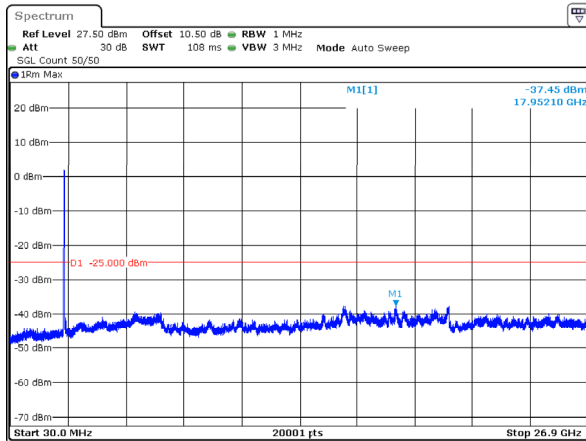


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:40:10

n41_60MHz_30kHz_2526MHz_DFT-s-OFDM
QPSK_RB1@0 -37.47dBm

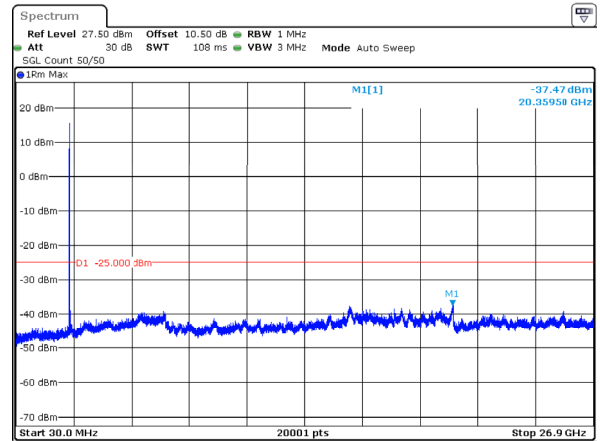


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:38:51

n41_60MHz_30kHz_2526MHz_DFT-s-OFDM
QPSK_RB1@161 -37.75dBm

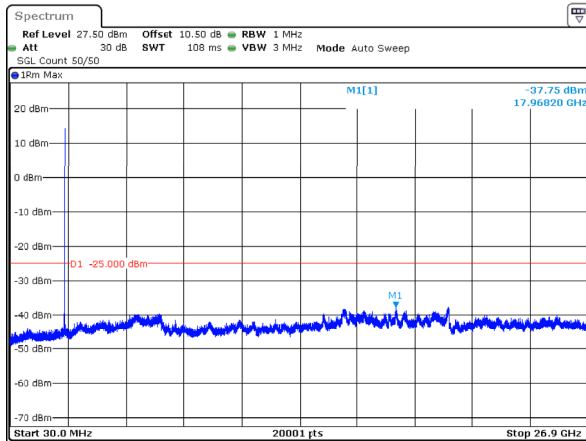


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:39:31

n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB162@0 -37.36dBm

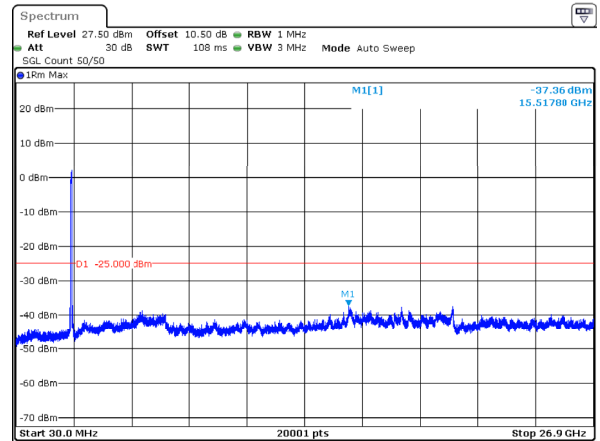


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:43:21

n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.89dBm

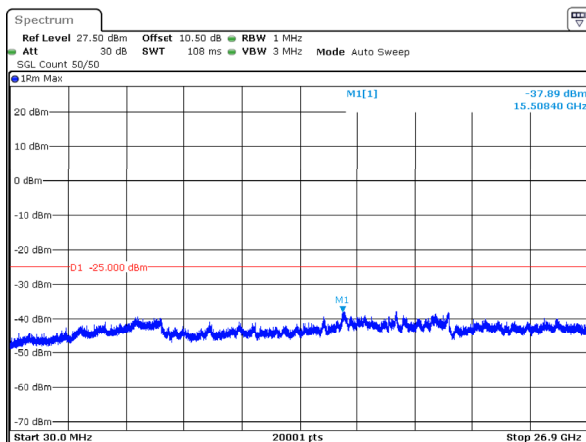


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:42:00

n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@161 -37.75dBm

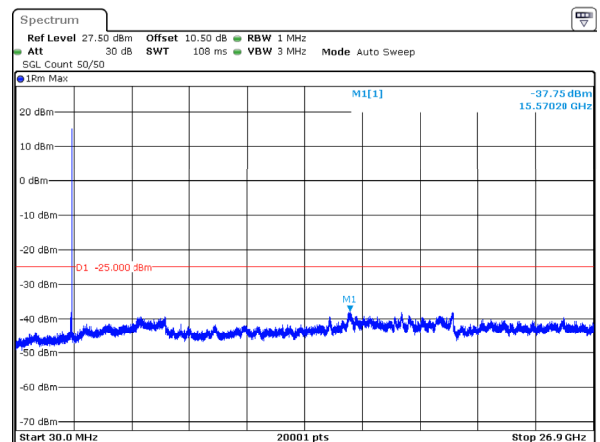


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:42:40

n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM
QPSK_RB162@0 -37.22dBm

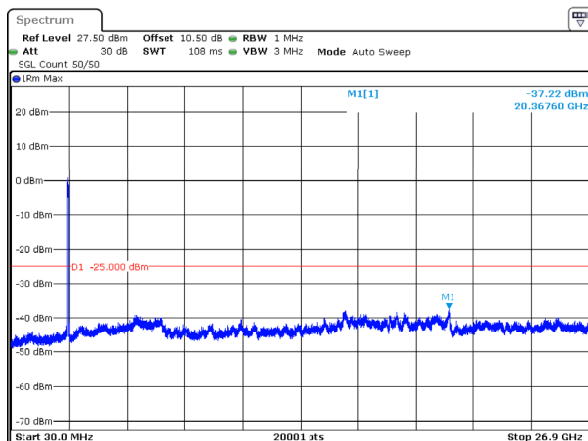


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:46:14

n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM
QPSK_RB1@0 -37.28dBm

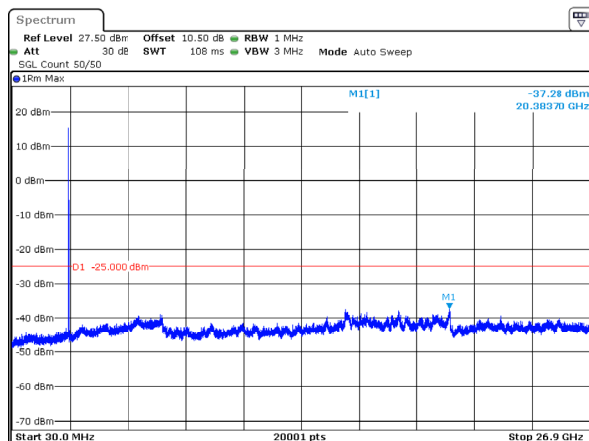


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:44:55

n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM
QPSK_RB1@161 -37.24dBm

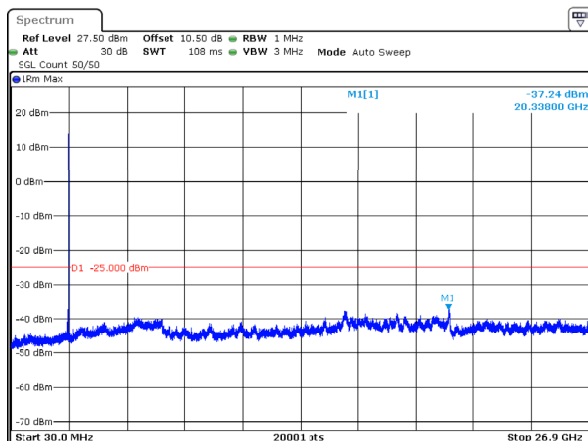


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:45:35

n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM
QPSK_RB1@0 -37.35dBm

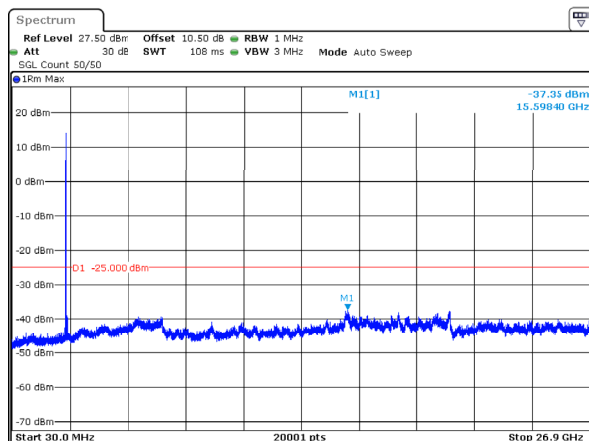


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:44:24

n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM
QPSK_RB1@216 -37.08dBm

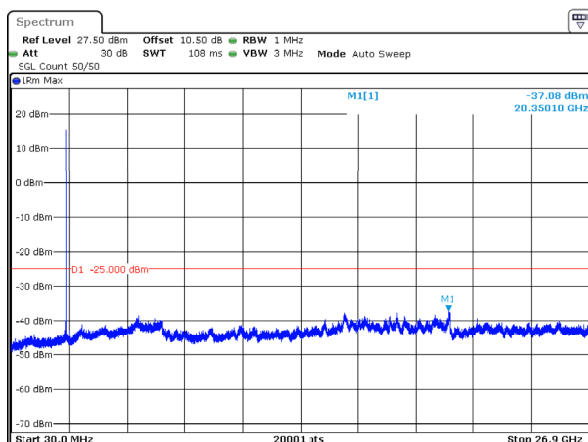


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:49:04

n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM
QPSK_RB216@0 -37.30dBm

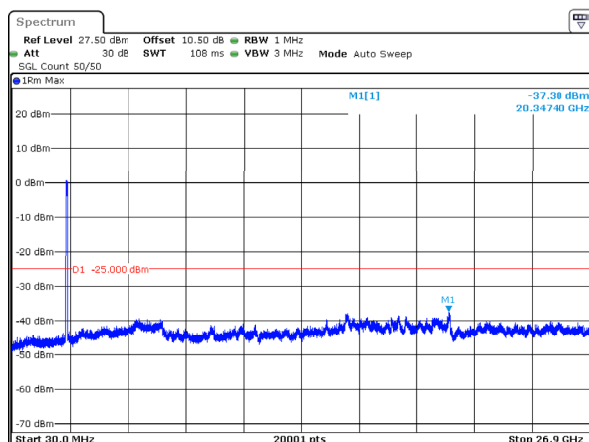


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:49:44

n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.54dBm

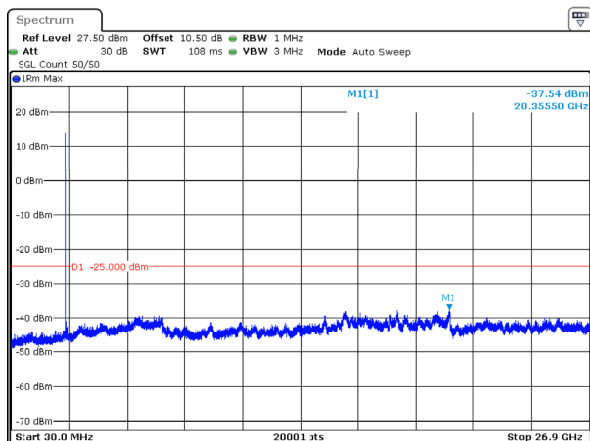


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:51:36

n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@216 -37.87dBm

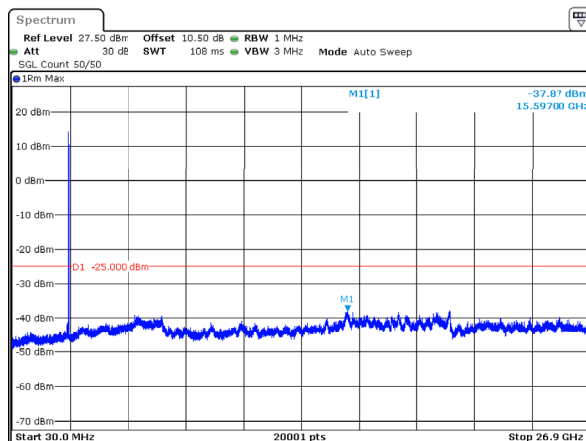


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:52:15

n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB216@0 -37.66dBm

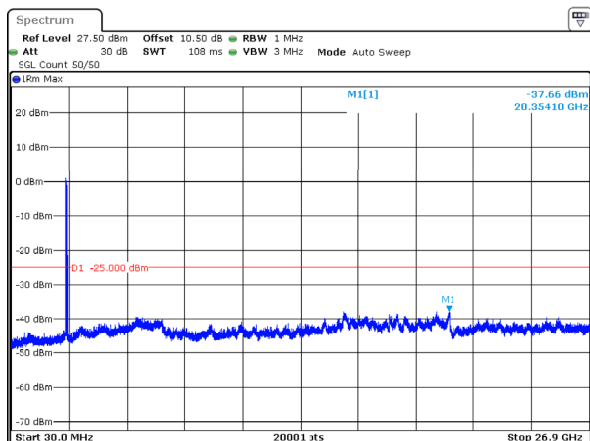


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:52:56

n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.57dBm

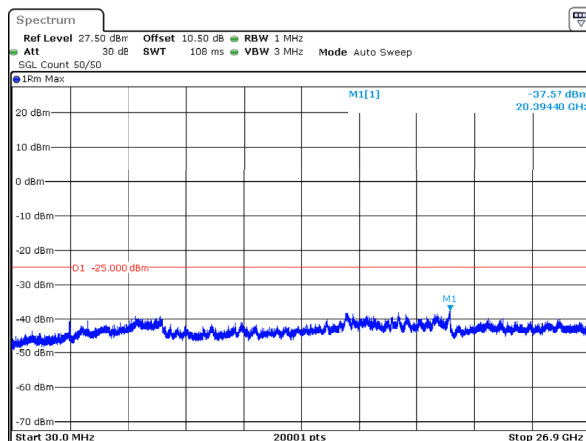


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:54:30

n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM
QPSK_RB1@216 -36.99dBm

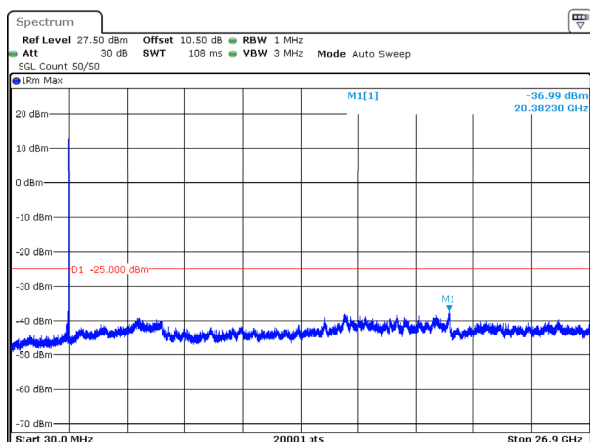


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:55:11

n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM
QPSK_RB216@0 -36.54dBm

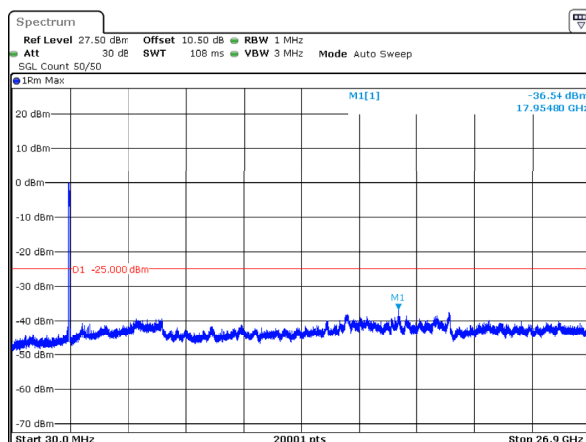


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:55:51

n41_90MHz_30kHz_2541MHz_DFT-s-OFDM
QPSK_RB1@0 -36.78dBm

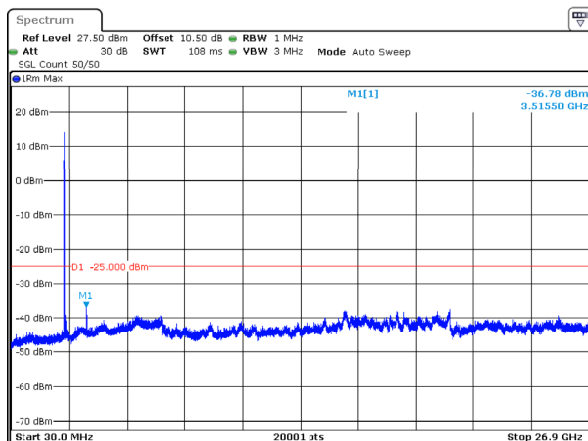


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:56:58

n41_90MHz_30kHz_2541MHz_DFT-s-OFDM
QPSK_RB1@244 -37.73dBm

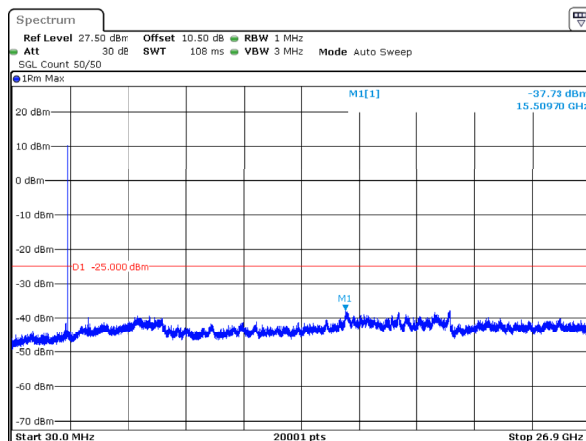


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:57:38

n41_90MHz_30kHz_2541MHz_DFT-s-OFDM
QPSK_RB243@0 -37.36dBm

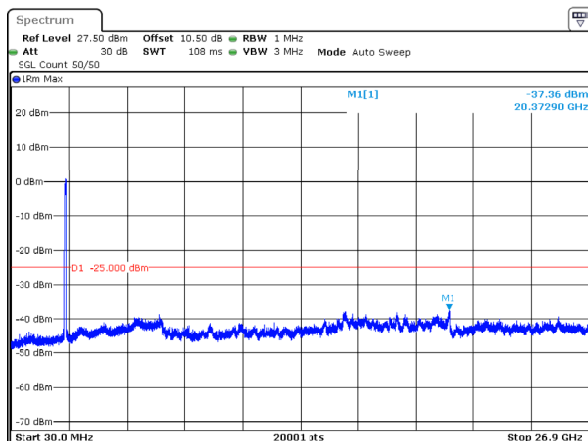


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 16:58:19

n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.05dBm

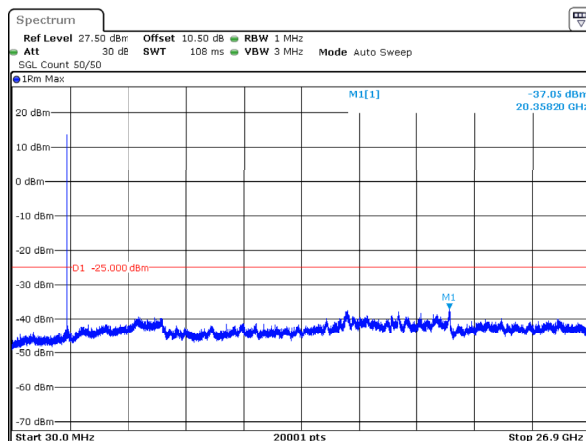


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:00:07

n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@244 -37.06dBm

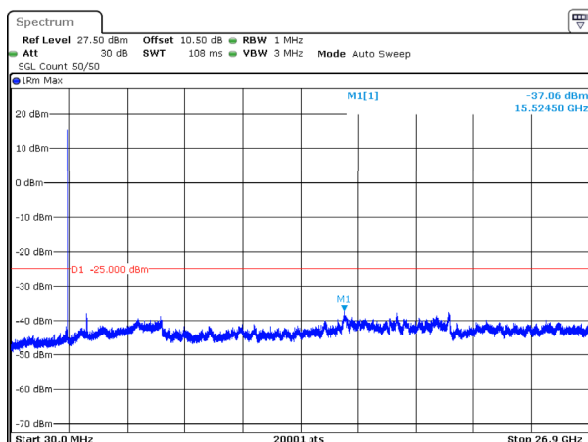


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:00:48

n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB243@0 -37.53dBm

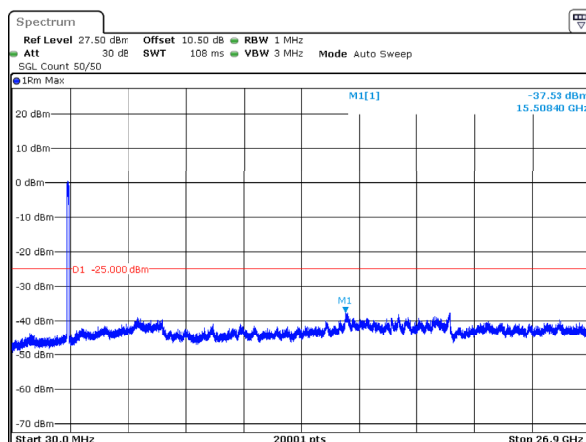


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:01:28

n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM
QPSK_RB1@0 -37.55dBm

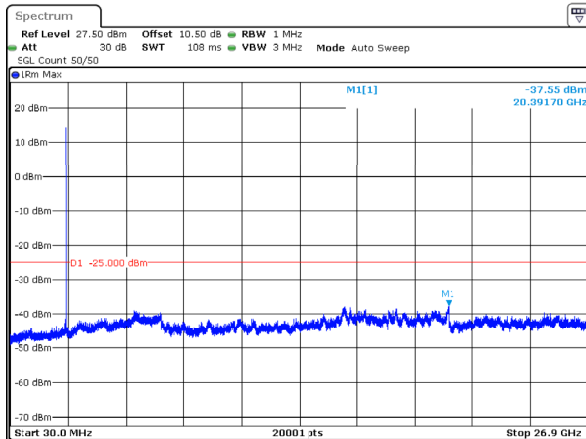


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:02:35

n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM
QPSK_RB1@244 -31.58dBm

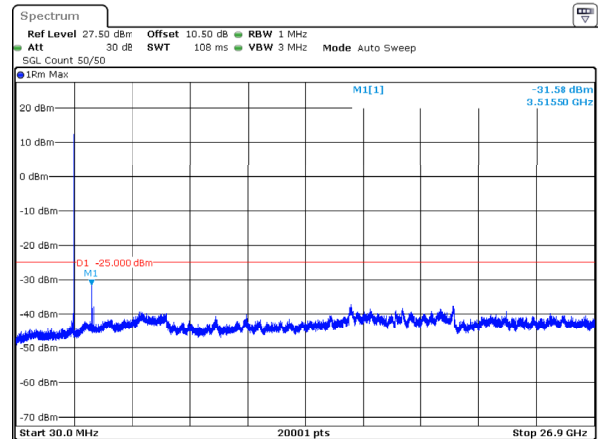


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:03:16

n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM
QPSK_RB243@0 -33.69dBm

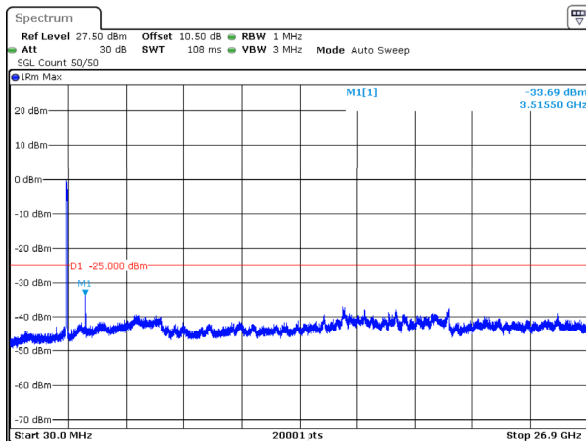


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:03:57

n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM
QPSK_RB1@0 -37.14dBm

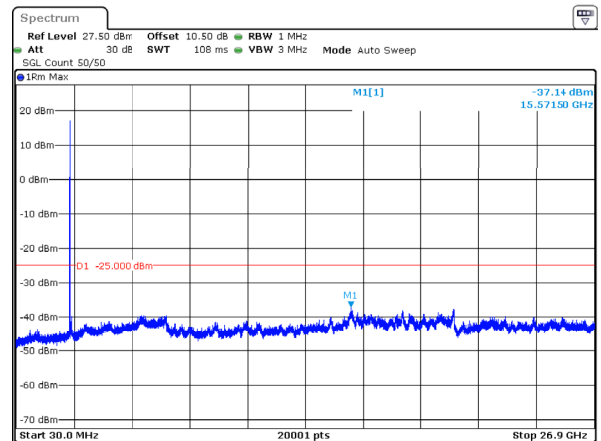


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:05:23

n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM
QPSK_RB1@272 -37.46dBm

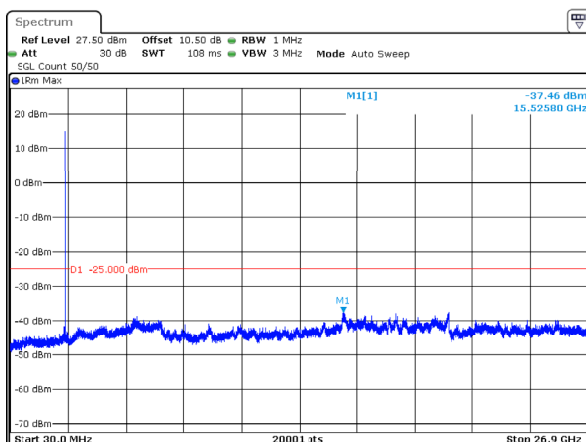


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:06:03

n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM
QPSK_RB270@0 -37.70dBm

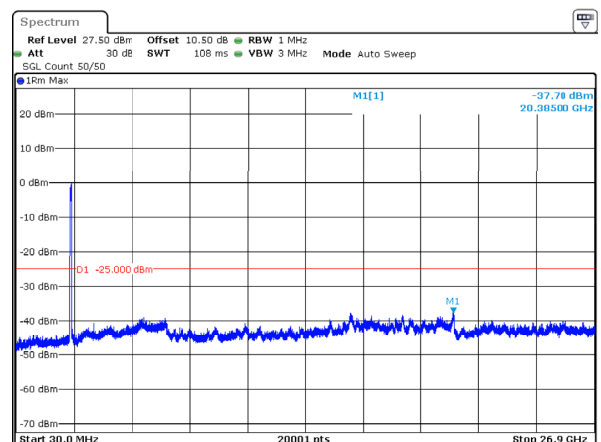


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:06:44

n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.51dBm

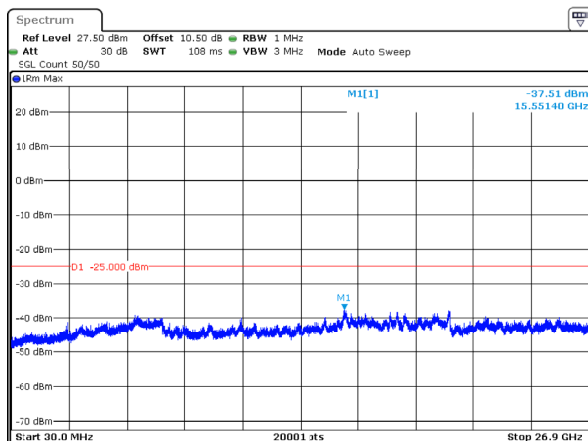


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:08:34

n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@272 -37.85dBm

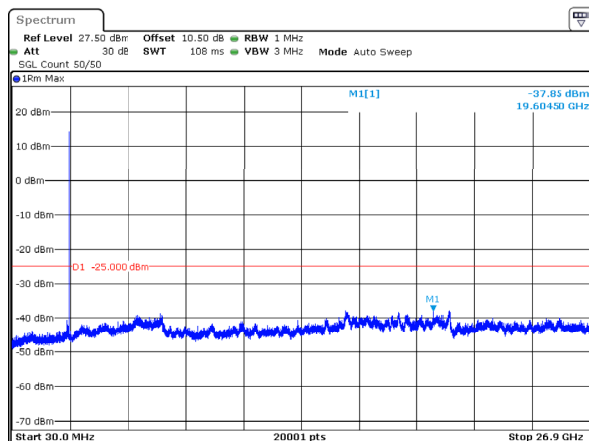


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:09:15

n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB270@0 -37.74dBm

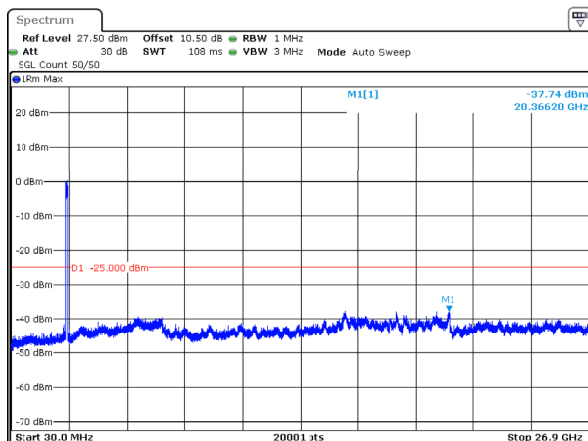


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:09:55

n41_100MHz_30kHz_2640MHz_DFT-s-OFDM
QPSK_RB1@0 -37.41dBm

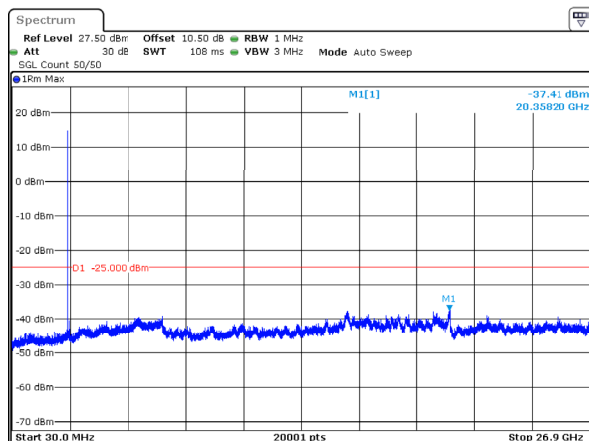


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:11:16

n41_100MHz_30kHz_2640MHz_DFT-s-OFDM
QPSK_RB1@272 -36.17dBm

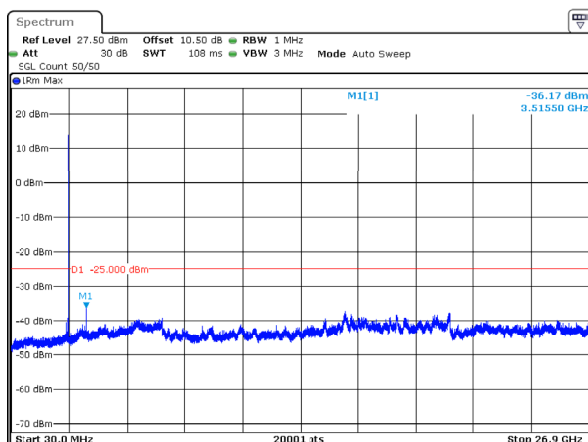

ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:11:55


n41_100MHz_30kHz_2640MHz_DFT-s-OFDM
QPSK_RB270@0 -37.64dBm

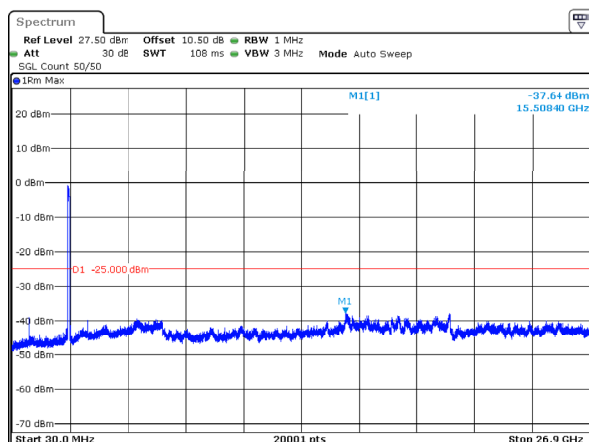

ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:12:35


n66

n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM
QPSK_RB1@0 -36.40dBm

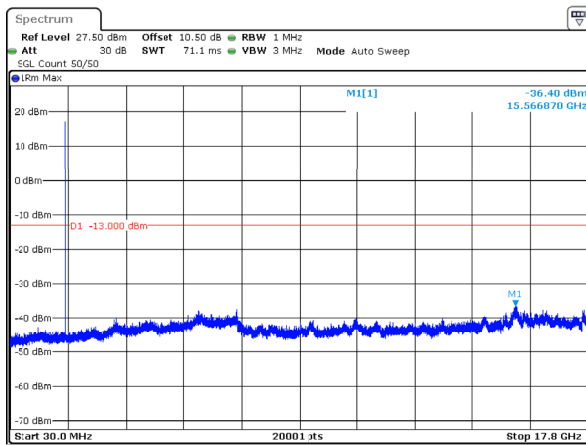


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:13:52

n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM
QPSK_RB1@24 -36.28dBm

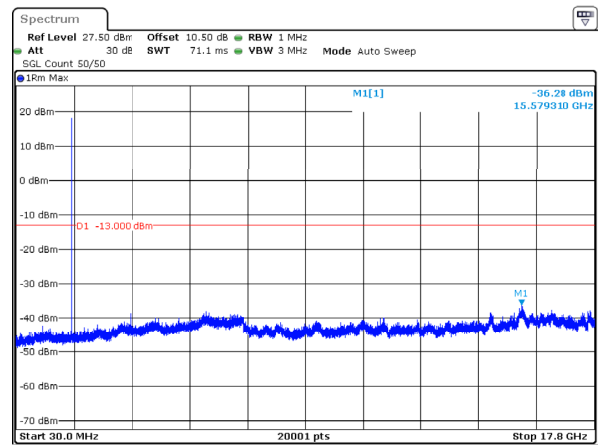


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:14:26

n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM
QPSK_RB25@0 -36.71dBm

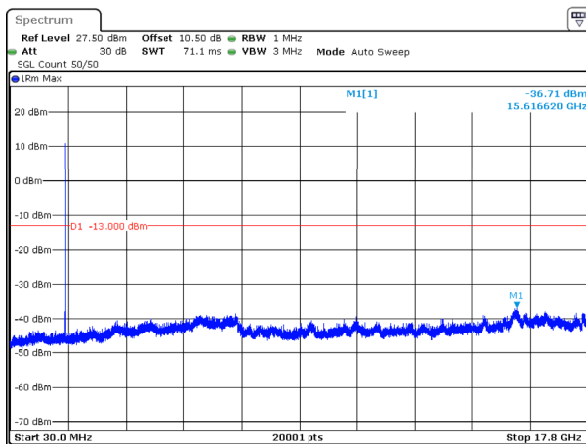


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:15:01

n66_5MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0 -37.05dBm

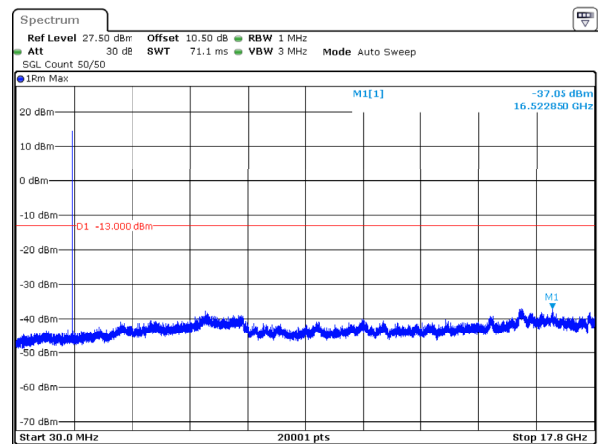


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:16:44

n66_5MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@24 -36.16dBm

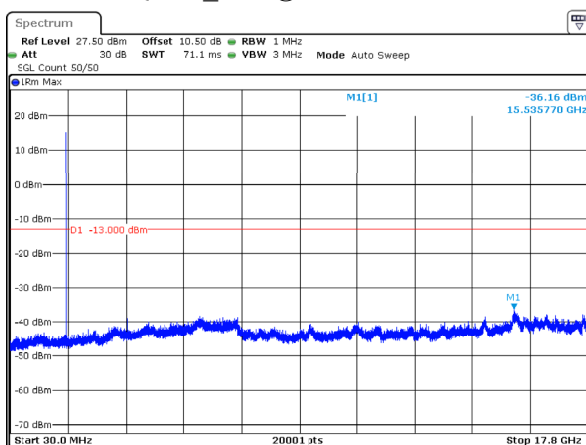


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:17:19

n66_5MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB25@0 -36.71dBm

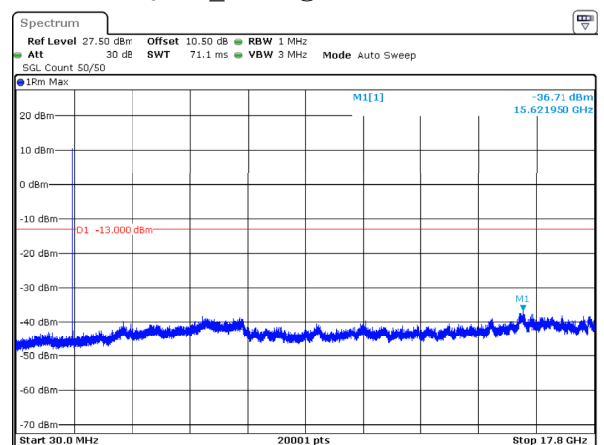


ProjectNo.:2401W26164E-RF Tester:Kungumaster Liang
Date: 11.SEP.2024 17:17:54

n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM
QPSK_RB1@0 -37.04dBm

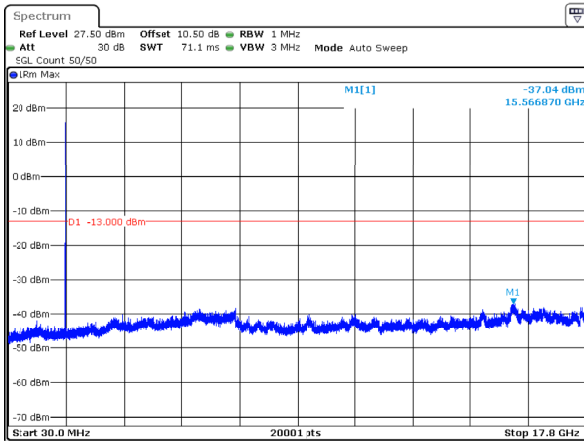


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:19:10

n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM
QPSK_RB1@24 -37.34dBm

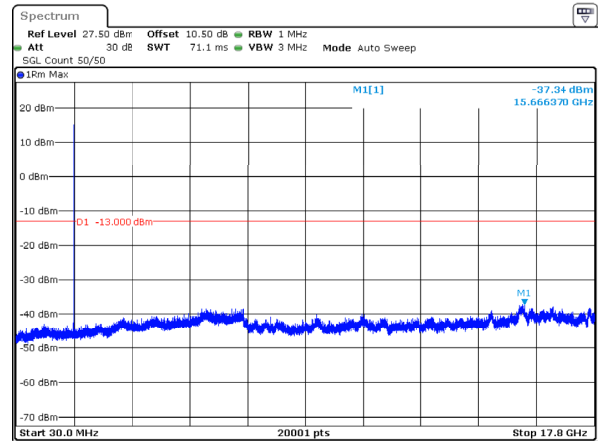


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:19:44

n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM
QPSK_RB25@0 -36.71dBm

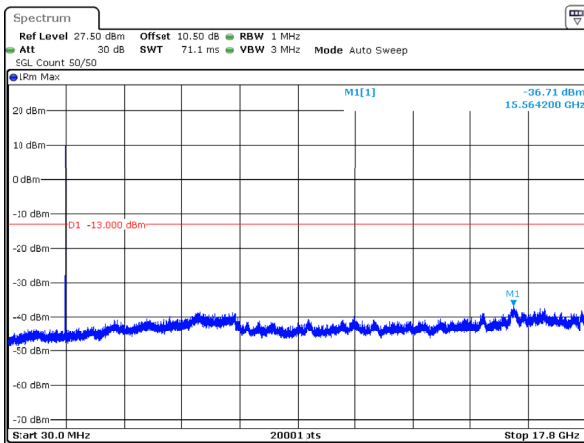


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:20:19

n66_10MHz_15kHz_1715MHz_DFT-s-OFDM
QPSK_RB1@0 -36.01dBm

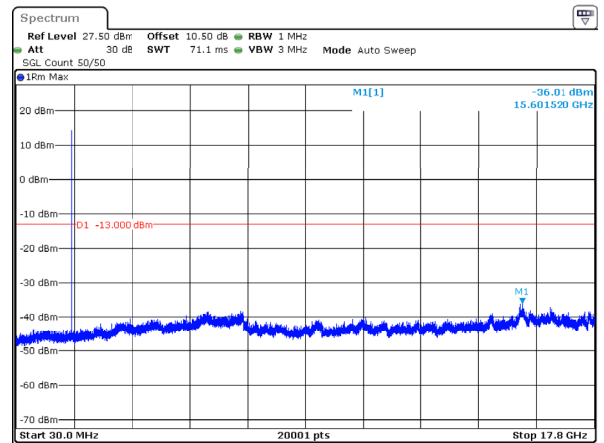


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:21:36

n66_10MHz_15kHz_1715MHz_DFT-s-OFDM
QPSK_RB1@51 -36.39dBm

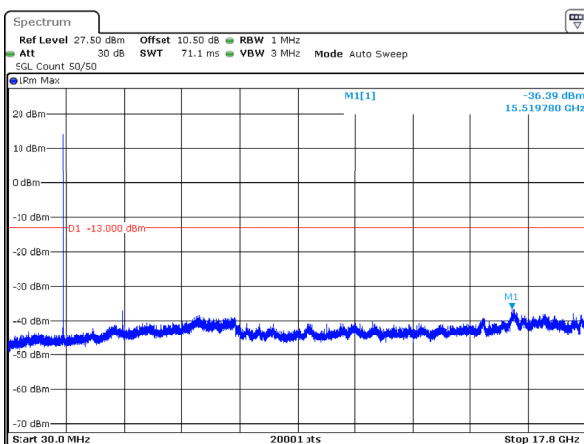


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:22:10

n66_10MHz_15kHz_1715MHz_DFT-s-OFDM
QPSK_RB50@0 -35.97dBm

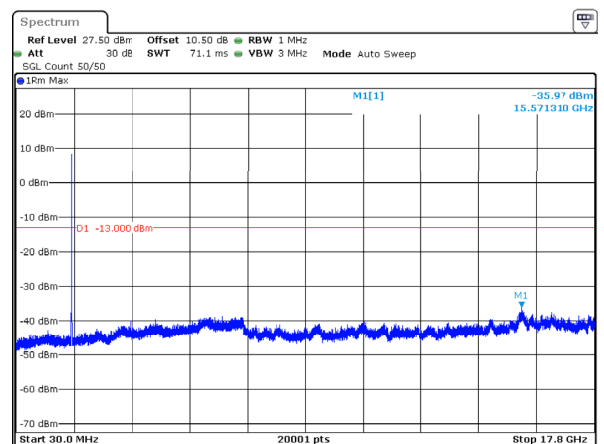


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:22:45

n66_10MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0 -37.16dBm

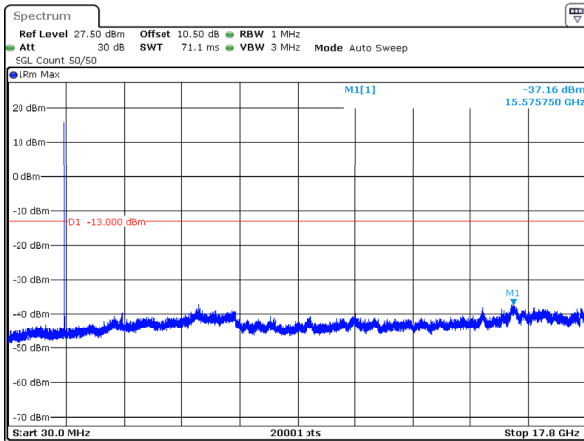


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:24:05

n66_10MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@51 -36.37dBm

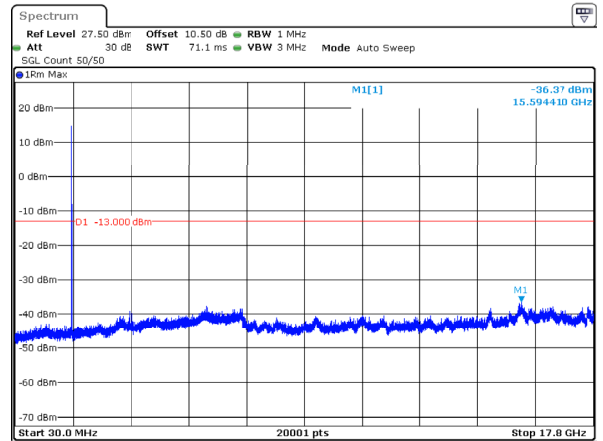


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:24:40

n66_10MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB50@0 -36.80dBm

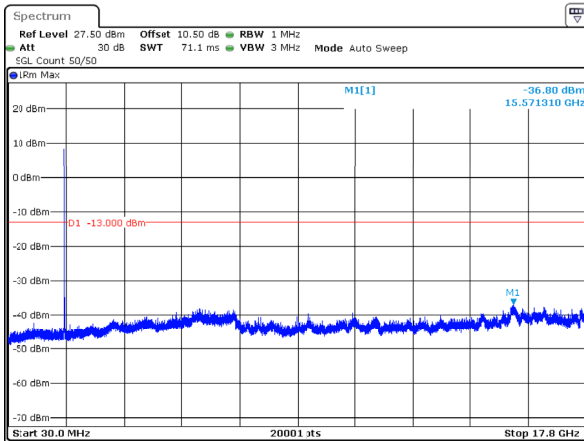


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:25:15

n66_10MHz_15kHz_1775MHz_DFT-s-OFDM
QPSK_RB1@0 -36.78dBm

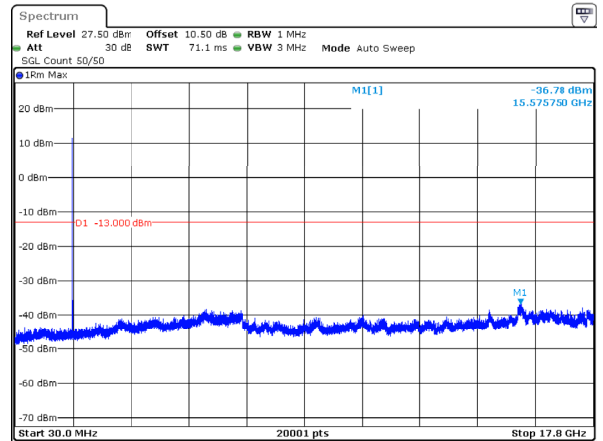


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:26:59

n66_10MHz_15kHz_1775MHz_DFT-s-OFDM
QPSK_RB1@51 -37.29dBm

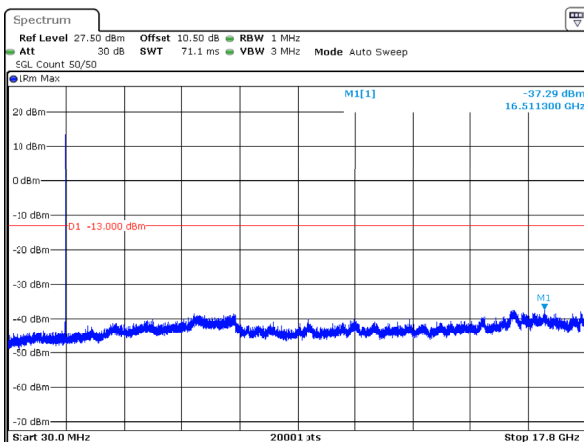


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:27:34

n66_10MHz_15kHz_1775MHz_DFT-s-OFDM
QPSK_RB50@0 -36.87dBm

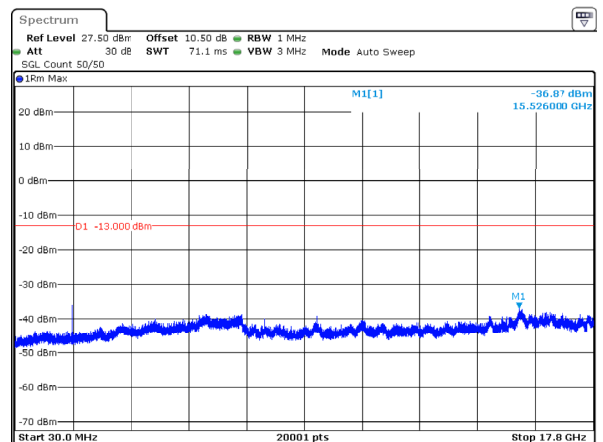


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:28:09

n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM
QPSK_RB1@0 -36.85dBm

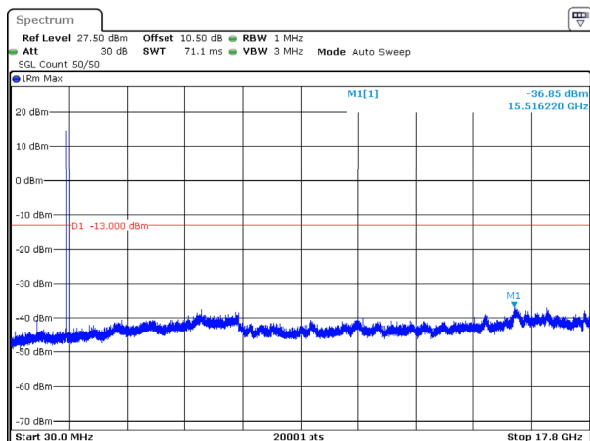


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:29:35

n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM
QPSK_RB1@78 -36.94dBm

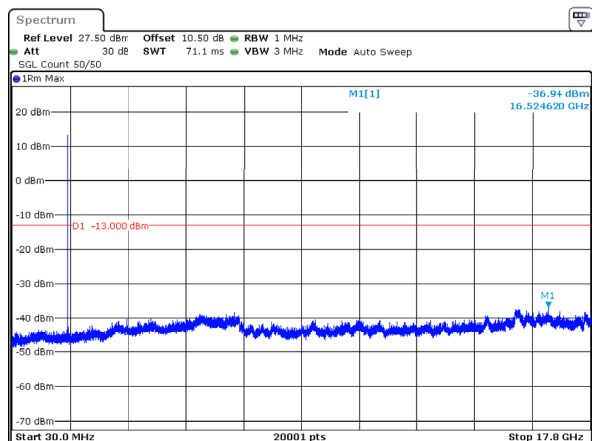


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:30:10

n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM
QPSK_RB75@0 -36.44dBm

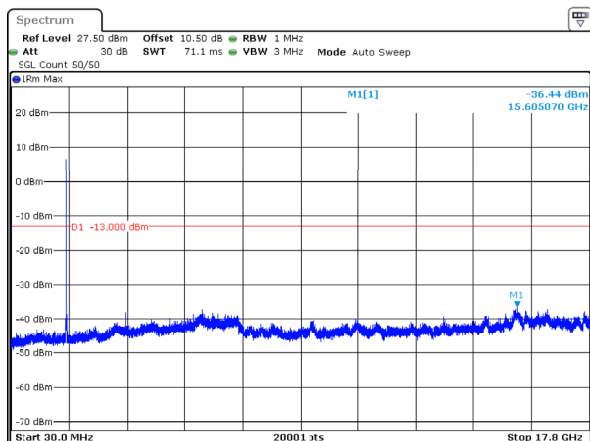


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:30:44

n66_15MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0 -37.05dBm

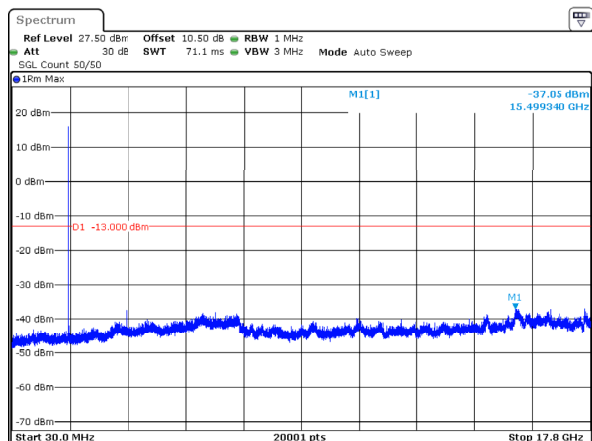


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:32:00

n66_15MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@78 -29.78dBm

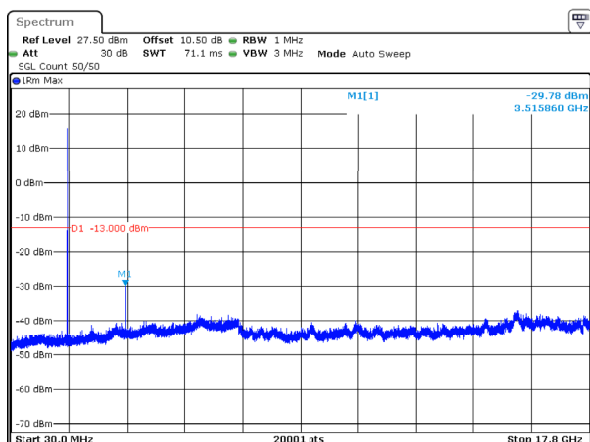


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:32:35

n66_15MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB75@0 -36.96dBm

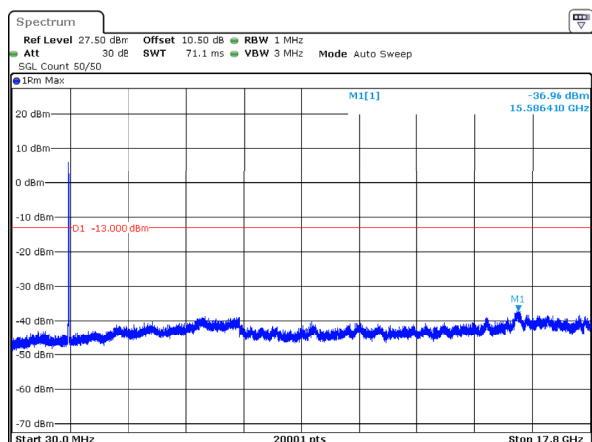


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:33:10

n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM
QPSK_RB1@0 -37.01dBm

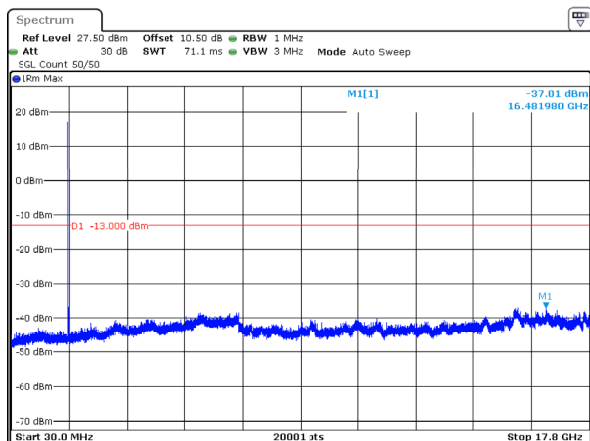


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:34:27

n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM
QPSK_RB1@78 -36.69dBm

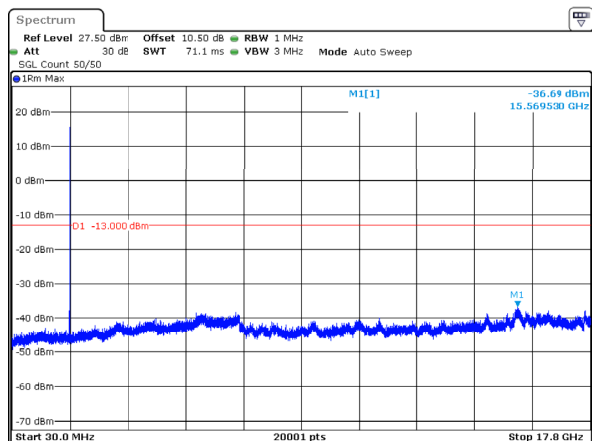


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:35:02

n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM
QPSK_RB75@0 -36.49dBm

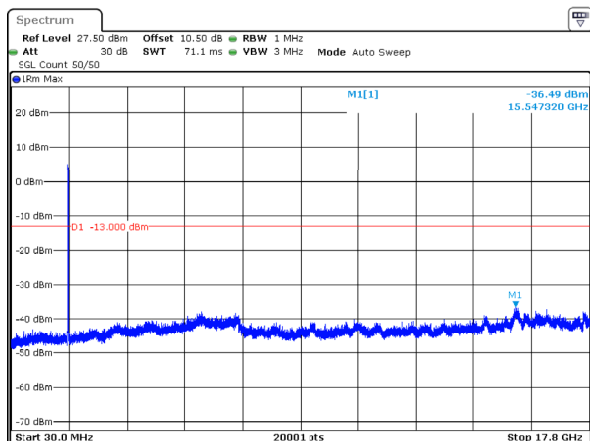


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:35:38

n66_20MHz_15kHz_1720MHz_DFT-s-OFDM
QPSK_RB100@0 -37.11dBm

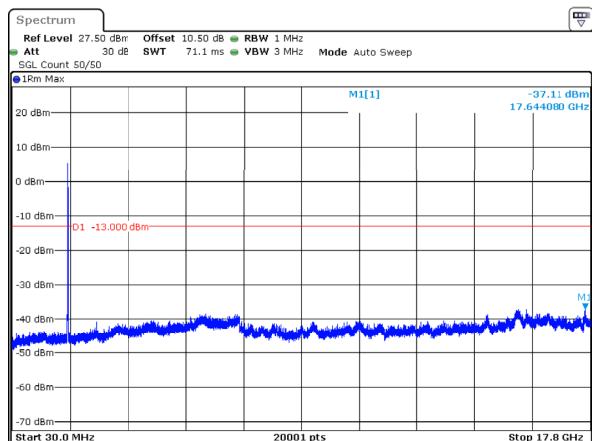


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:38:32

n66_20MHz_15kHz_1720MHz_DFT-s-OFDM
QPSK_RB1@0 -37.15dBm

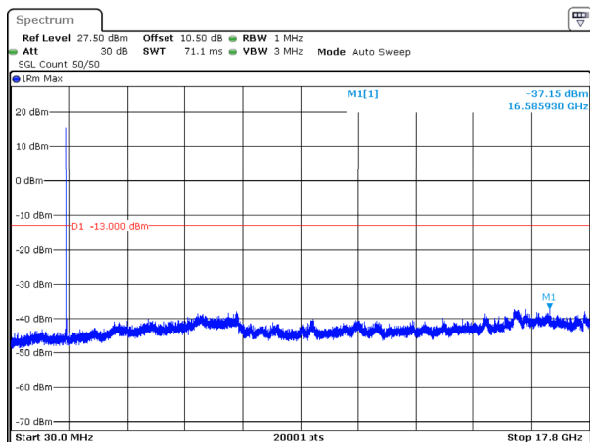


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:37:23

n66_20MHz_15kHz_1720MHz_DFT-s-OFDM
QPSK_RB1@105 -36.91dBm

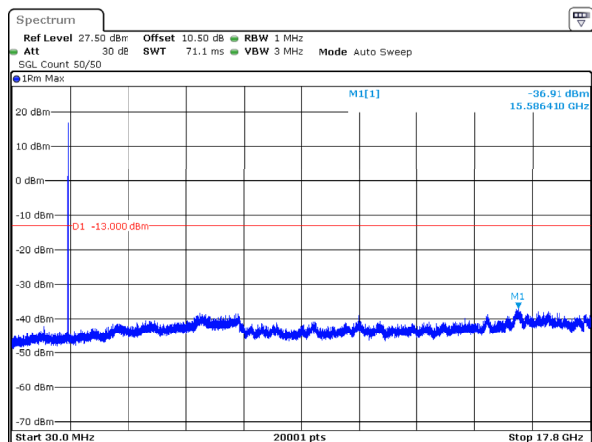


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 17:37:57

n66_20MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB100@0 -36.98dBm

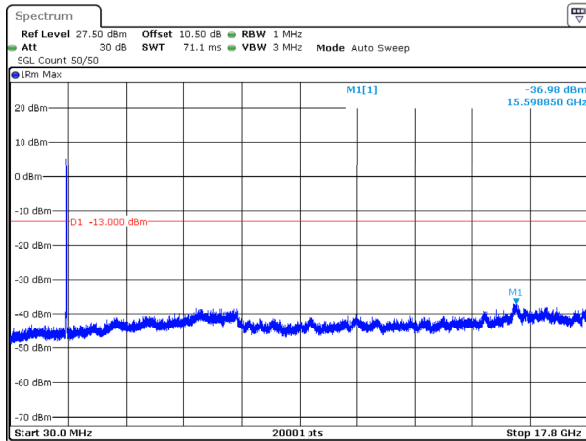


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:41:31

n66_20MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0 -36.36dBm

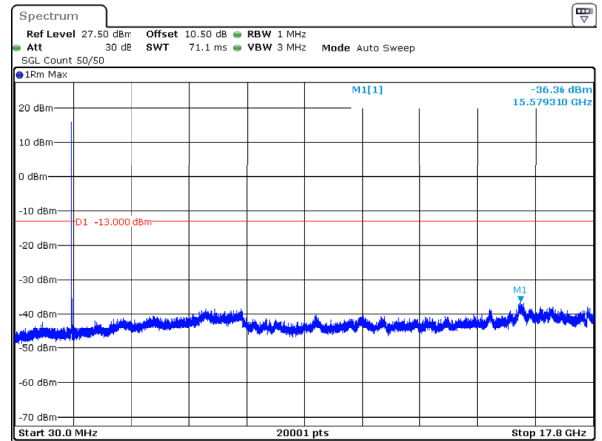


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:40:20

n66_20MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@105 -37.27dBm

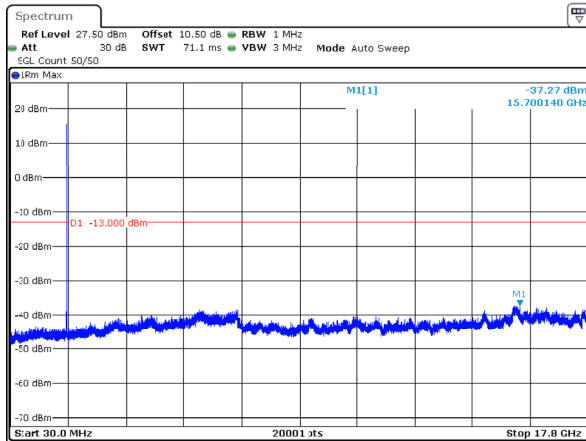


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:40:54

n66_20MHz_15kHz_1770MHz_DFT-s-OFDM
QPSK_RB100@0 -36.53dBm

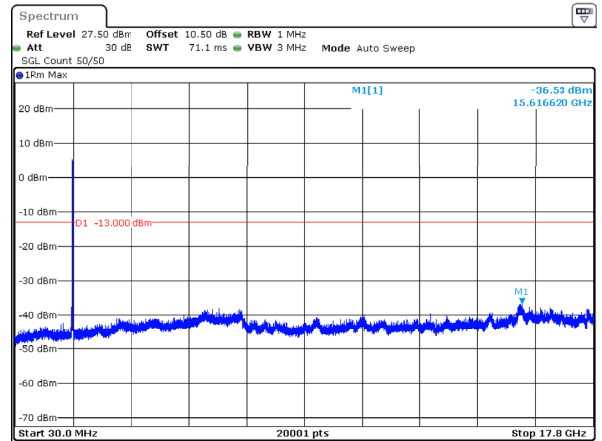


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:44:24

n66_20MHz_15kHz_1770MHz_DFT-s-OFDM
QPSK_RB1@0 -36.31dBm

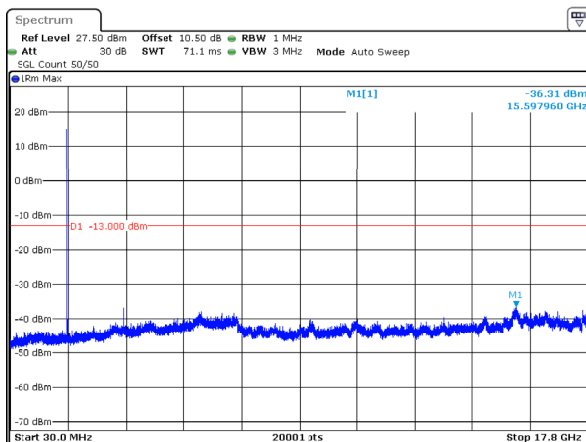


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:43:14

n66_20MHz_15kHz_1770MHz_DFT-s-OFDM
QPSK_RB1@105 -37dBm

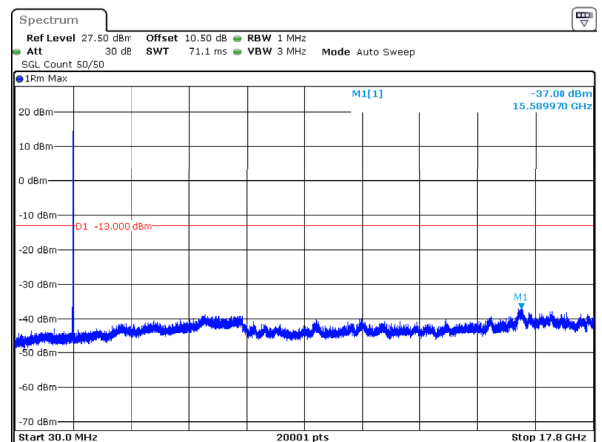


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:43:49

n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM
QPSK_RB128@0 -36.68dBm

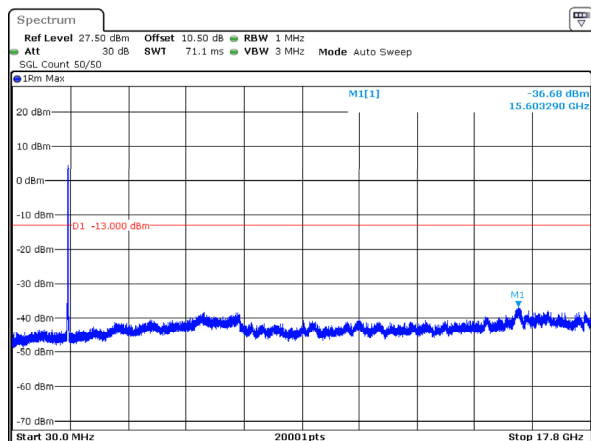


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:47:18

n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM
QPSK_RB1@0 -36.75dBm

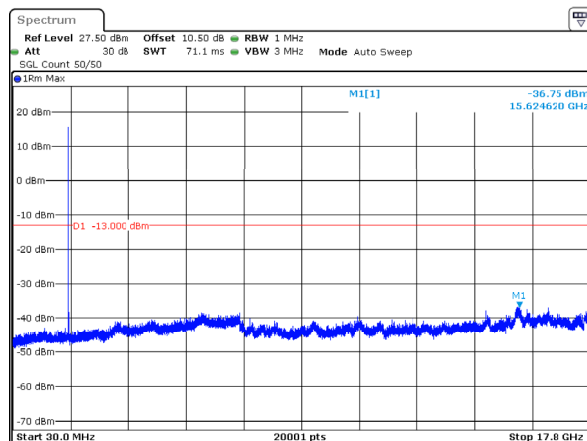


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:46:08

n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM
QPSK_RB1@132 -37.02dBm

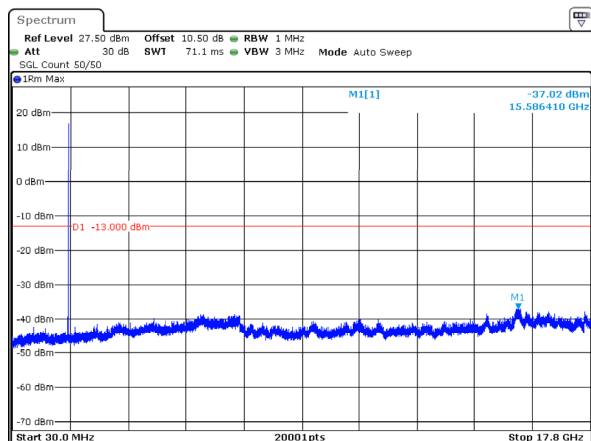


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:46:40

n66_25MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB128@0 -37.29dBm

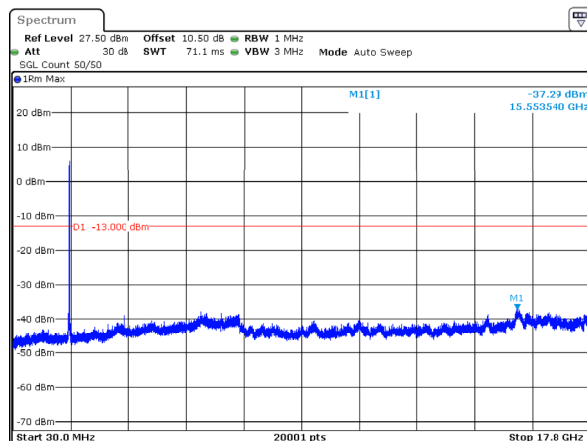


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:49:46

n66_25MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0 -36.10dBm

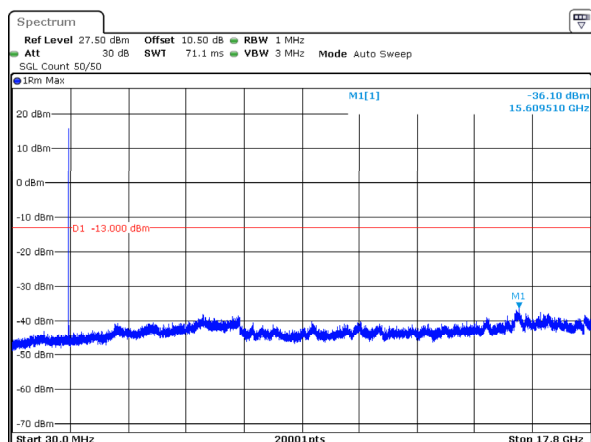


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:48:35

n66_25MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@132 -36.47dBm

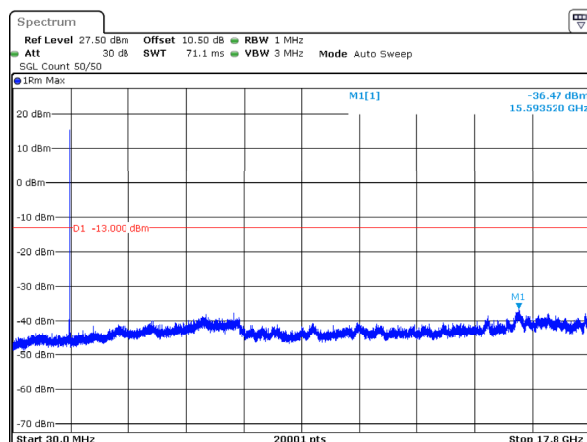


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:49:10

n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM
QPSK_RB128@0 -36.55dBm

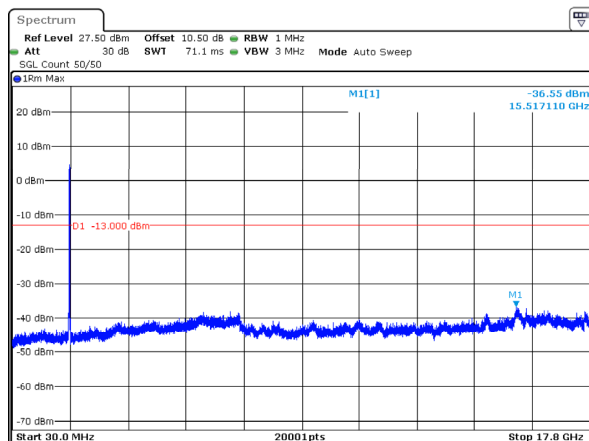


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:52:11

n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM
QPSK_RB1@0 -36.74dBm

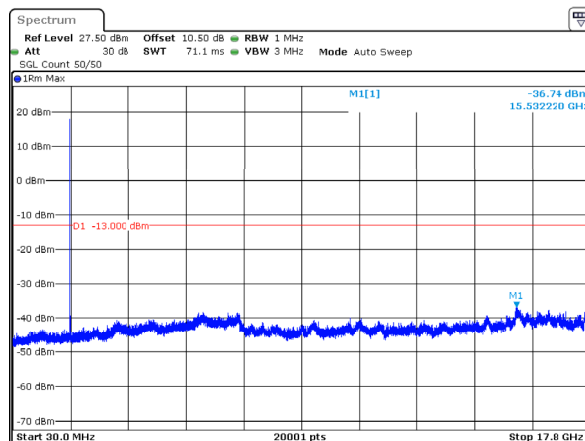


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:51:02

n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM
QPSK_RB1@132 -37.06dBm

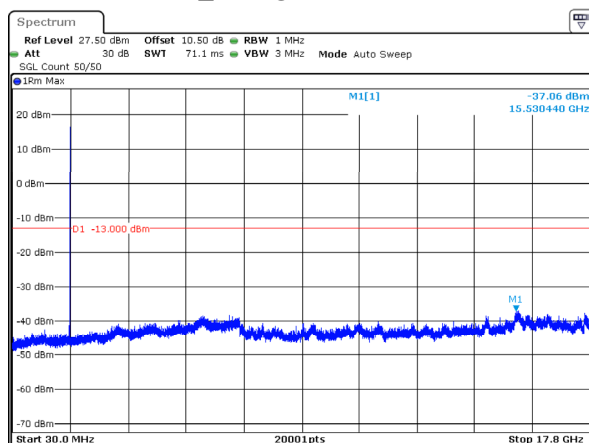


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:51:37

n66_30MHz_15kHz_1725MHz_DFT-s-OFDM
QPSK_RB160@0 -36.67dBm

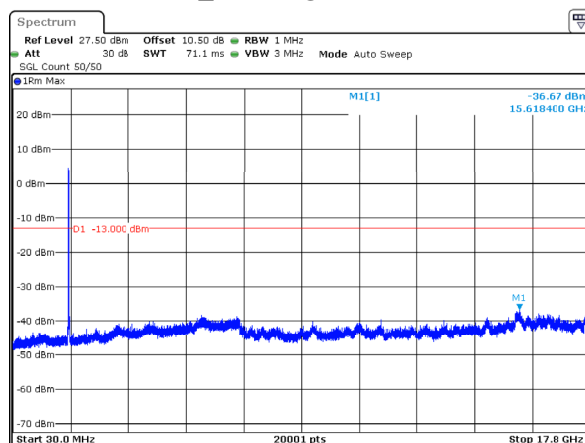


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:54:35

n66_30MHz_15kHz_1725MHz_DFT-s-OFDM
QPSK_RB1@0 -36.72dBm

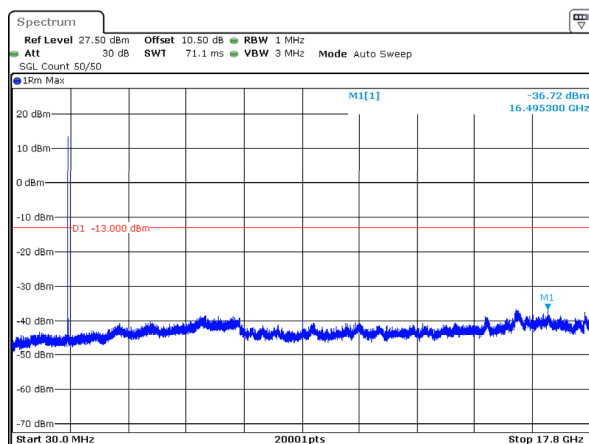


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:53:26

n66_30MHz_15kHz_1725MHz_DFT-s-OFDM
QPSK_RB1@159 -36.41dBm

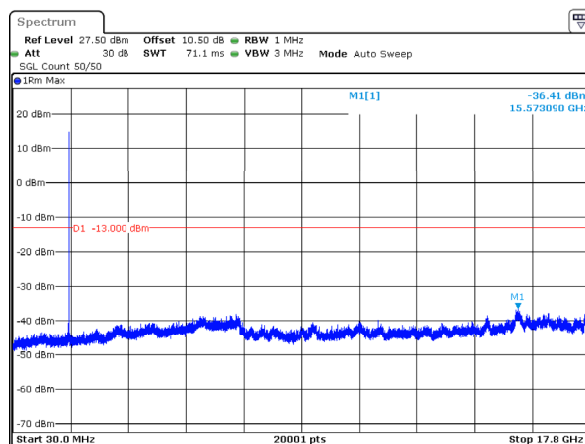


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:54:01

n66_30MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB160@0 -37.24dBm

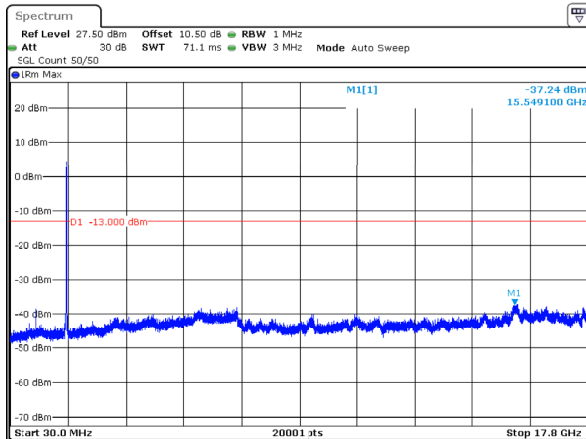


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:57:05

n66_30MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0 -36.14dBm

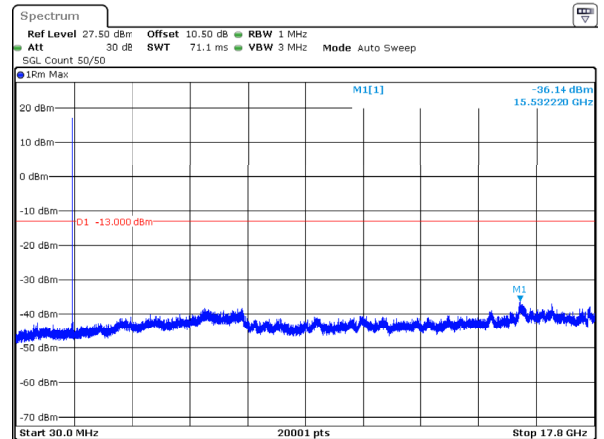


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:55:55

n66_30MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@159 -35.81dBm

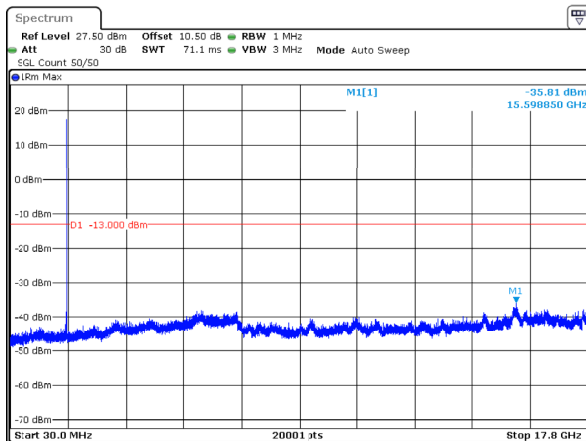


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:56:30

n66_30MHz_15kHz_1765MHz_DFT-s-OFDM
QPSK_RB160@0 -36.72dBm

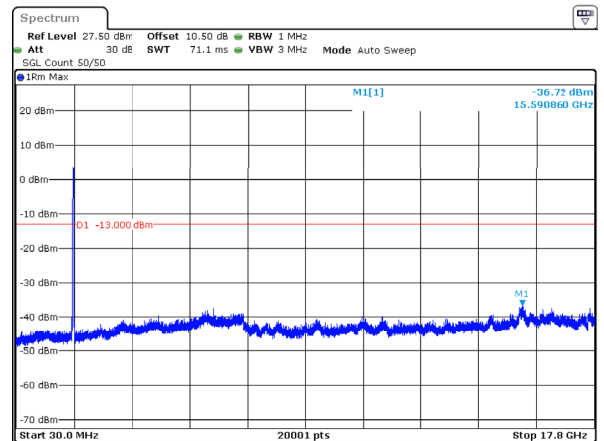


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 18:00:01

n66_30MHz_15kHz_1765MHz_DFT-s-OFDM
QPSK_RB1@0 -36.61dBm

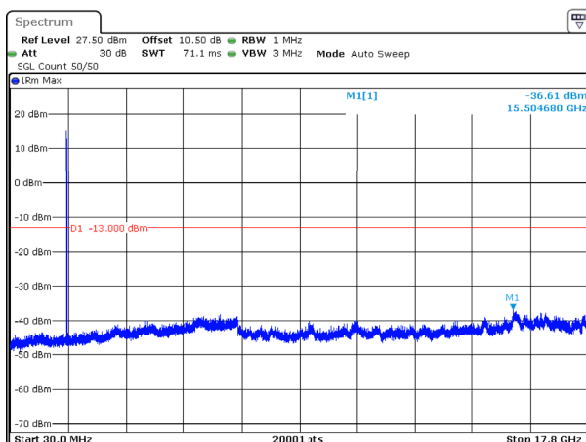


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:58:52

n66_30MHz_15kHz_1765MHz_DFT-s-OFDM
QPSK_RB1@159 -36.68dBm

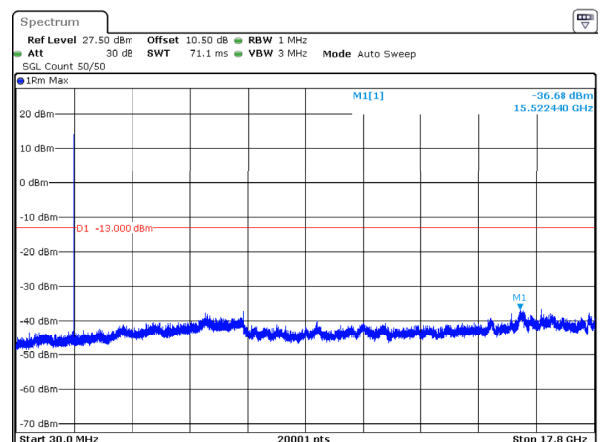


ProjectNo.:2401W26164E-RF Tester:Kungfumaster Liang
Date: 11.SEP.2024 17:59:26

n66_40MHz_15kHz_1730MHz_DFT-s-OFDM
QPSK_RB1@0 -37.08dBm

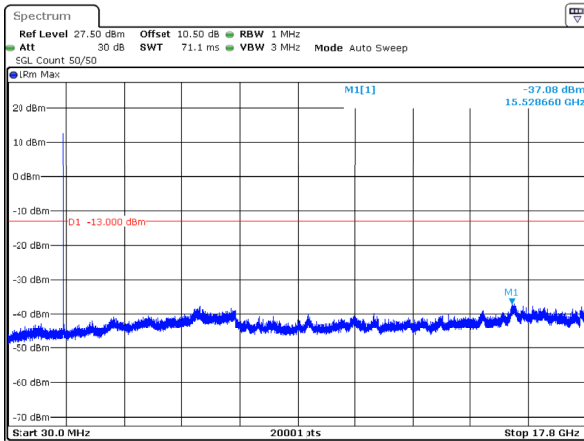


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 18:01:20

n66_40MHz_15kHz_1730MHz_DFT-s-OFDM
QPSK_RB1@215 -37.16dBm

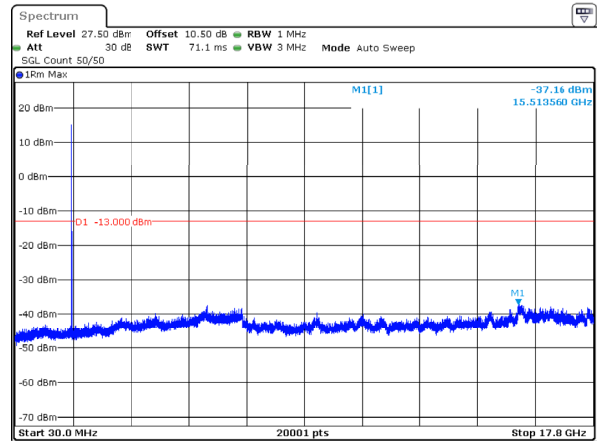


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 18:01:54

n66_40MHz_15kHz_1730MHz_DFT-s-OFDM
QPSK_RB216@0 -36.52dBm

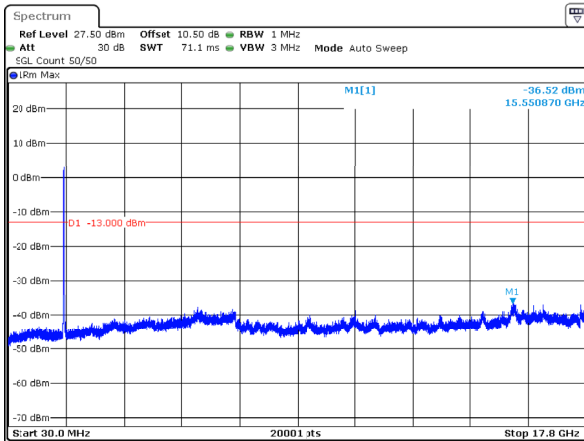


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 18:02:29

n66_40MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0 -36.50dBm

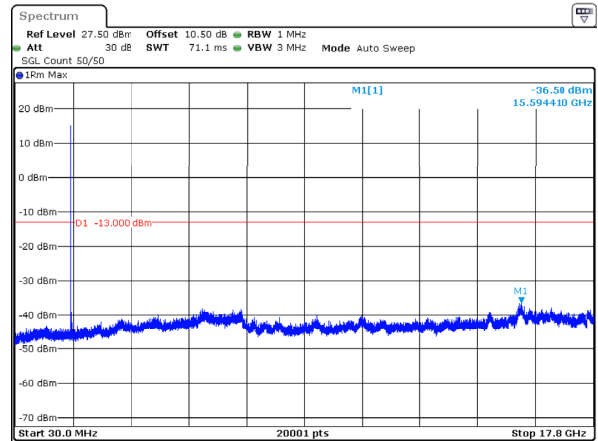


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 18:04:16

n66_40MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@215 -36.55dBm

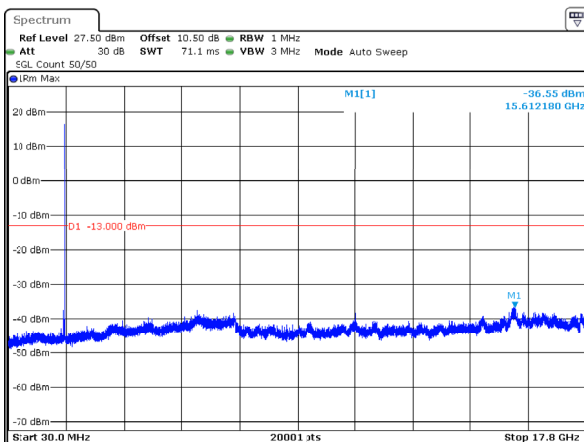


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 18:04:51

n66_40MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB216@0 -36.85dBm

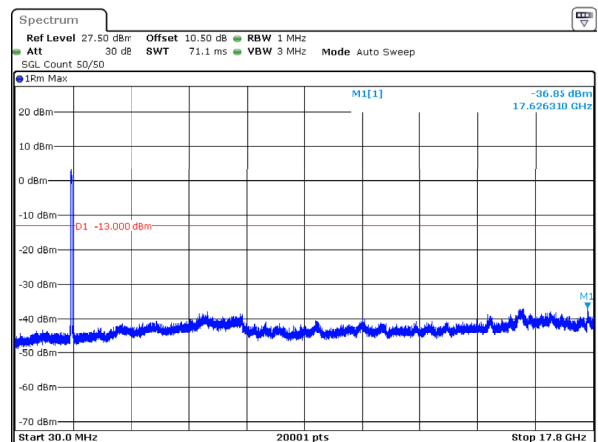


ProjectNo.:2401W26164E-RF Tester:Kungfmaster Liang
Date: 11.SEP.2024 18:05:25

n66_40MHz_15kHz_1760MHz_DFT-s-OFDM
QPSK_RB1@0 -36.74dBm

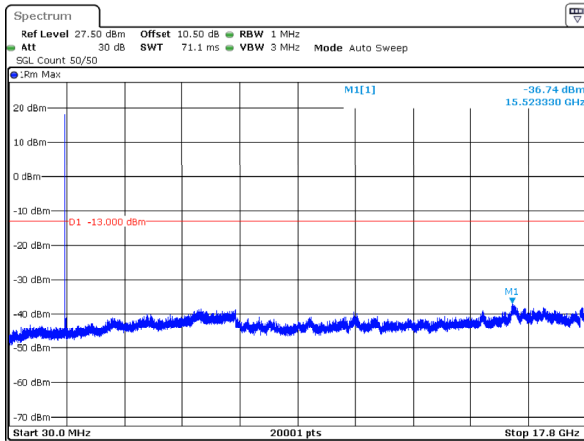

ProjectNo.:2401W26164E-RF Tester:Rungfumeaster Liang
Date: 11.SEP.2024 18:06:45


n66_40MHz_15kHz_1760MHz_DFT-s-OFDM
QPSK_RB1@215 -35.68dBm

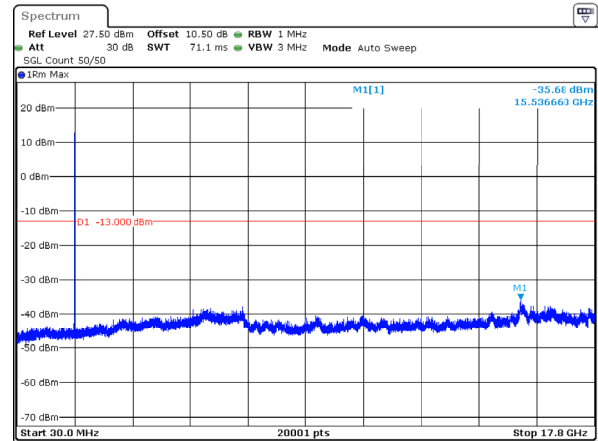

ProjectNo.:2401W26164E-RF Tester:Rungfumeaster Liang
Date: 11.SEP.2024 18:07:20


n77_1

n66_40MHz_15kHz_1760MHz_DFT-s-OFDM
QPSK_RB216@0 -36.91dBm

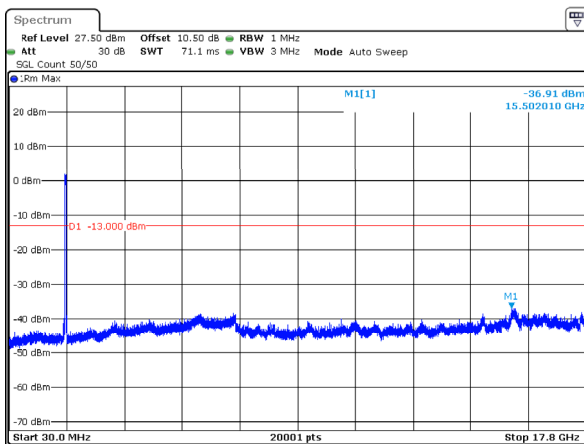


ProjectNo.:2401W26164E-RF Tester:Rungfumeaster Liang
Date: 11.SEP.2024 18:07:54

n77_1_10MHz_30kHz_3455MHz_DFT-s-OFDM
QPSK_RB1@0 -37.94dBm

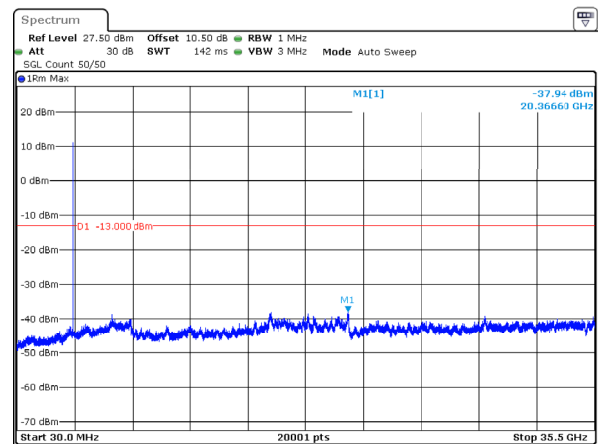


ProjectNo.:2401W26164E-RF Tester:Rungfumeaster Liang
Date: 11.SEP.2024 18:56:24

n77_1_10MHz_30kHz_3455MHz_DFT-s-OFDM
QPSK_RB1@0 -39.94dBm

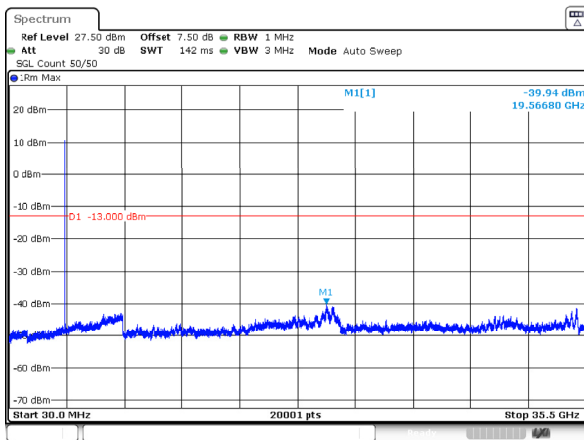

ProjectNo.:2401W26164E-RF Tester:Rungfumeaster Liang
Date: 23.SEP.2024 22:37:43

n77_1_10MHz_30kHz_3455MHz_DFT-s-OFDM
QPSK_RB1@23 -41.04dBm

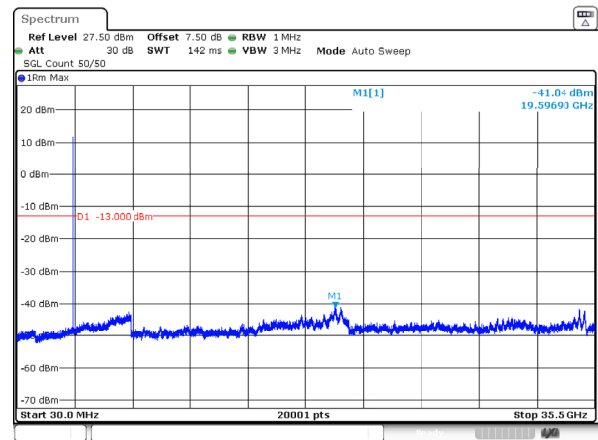

ProjectNo.:2401W26164E-RF Tester:Rungfumeaster Liang
Date: 22.SEP.2024 18:54:02