



1.4MHz_High_QPSK_1@5

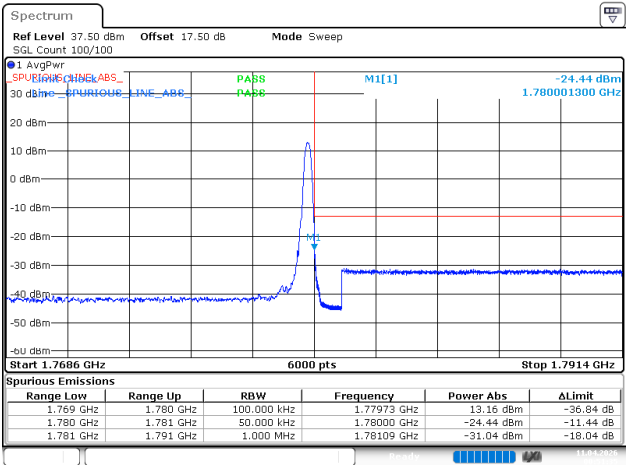


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:51:35

1.4MHz_High_QPSK_6@0

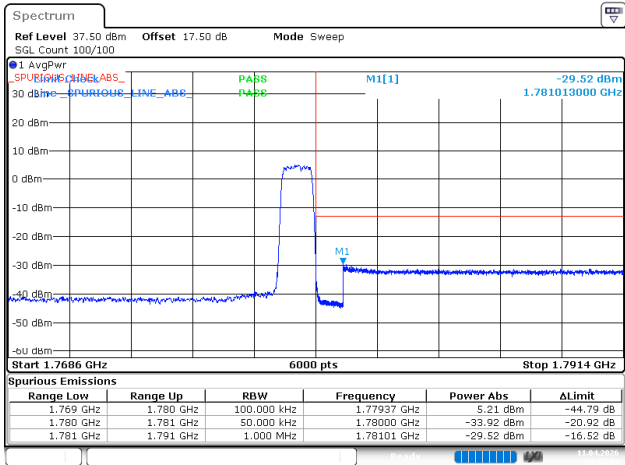


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:52:04

1.4MHz_High_16QAM_1@5

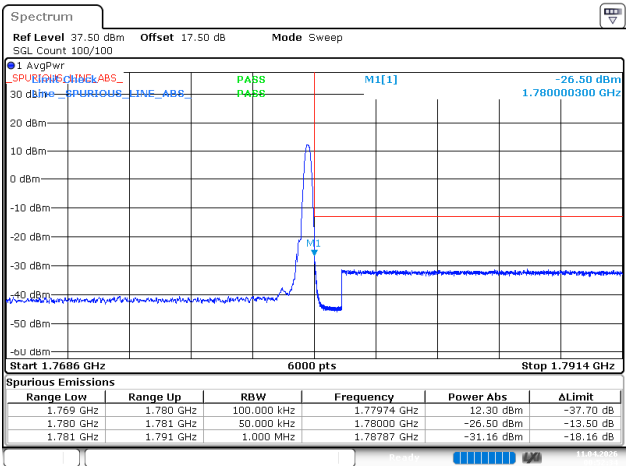


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:52:14

1.4MHz_High_16QAM_6@0

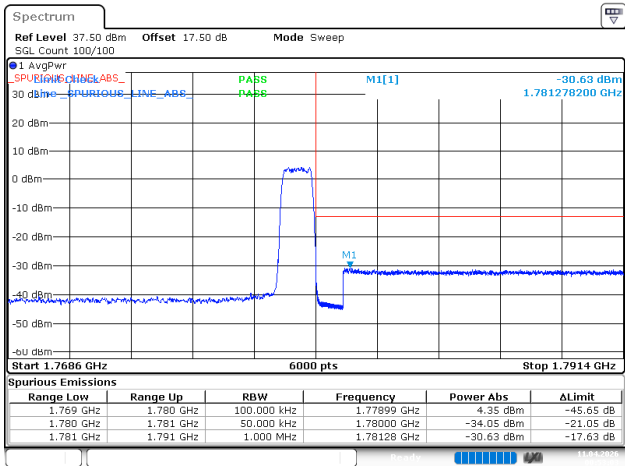


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:53:03

3MHz_Low_QPSK_1@0

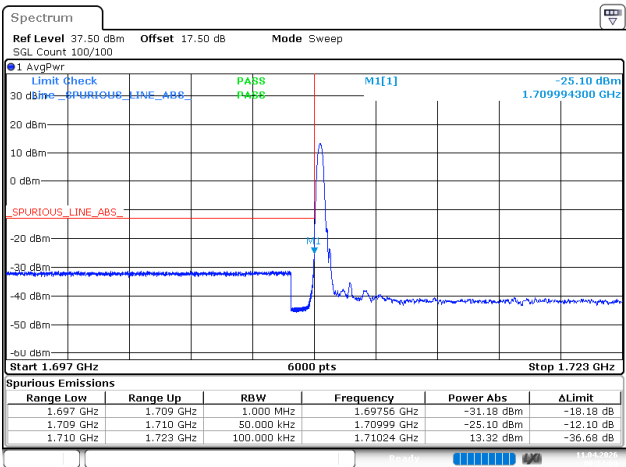


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:54:00

3MHz_Low_QPSK_15@0

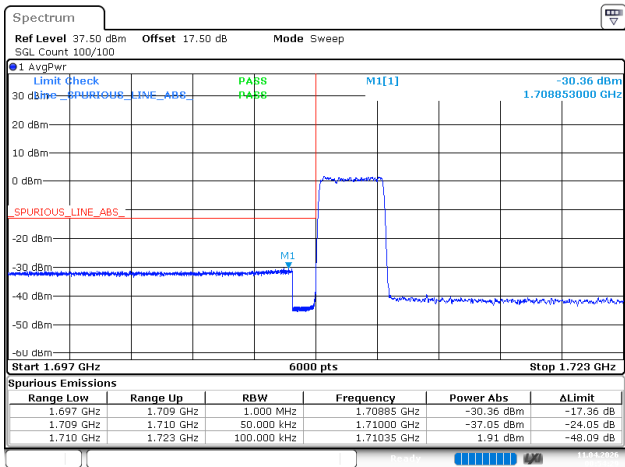


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:54:29

3MHz_Low_16QAM_1@0

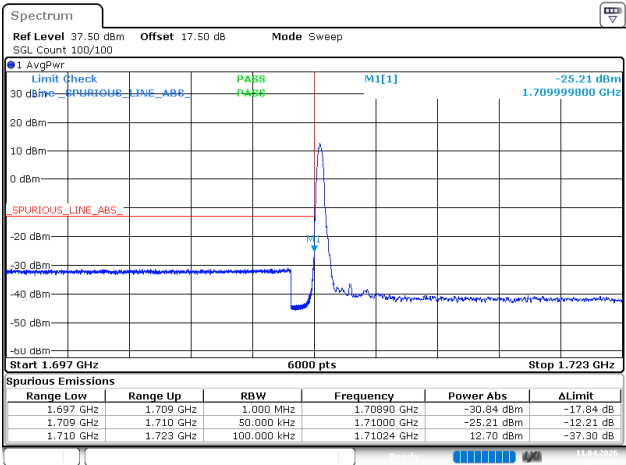


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:54:58

3MHz_Low_16QAM_15@0

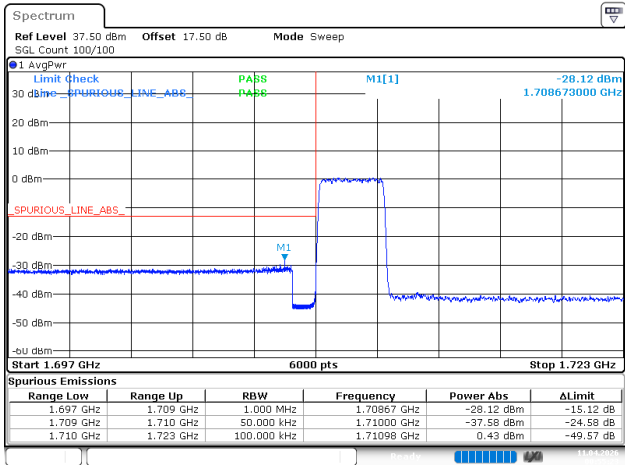


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:55:24

3MHz_High_QPSK_1@14

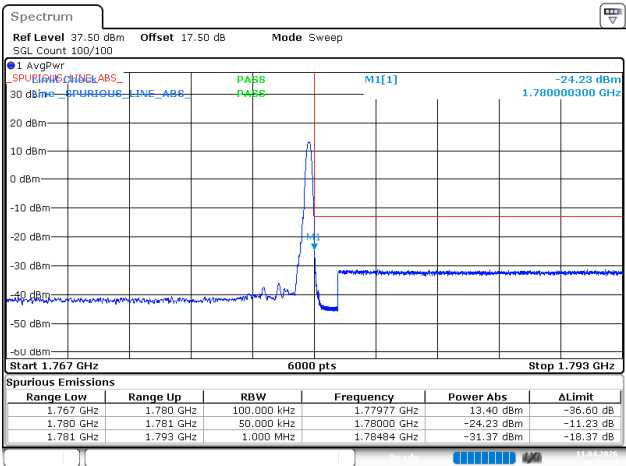


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:55:50

3MHz_High_QPSK_15@0

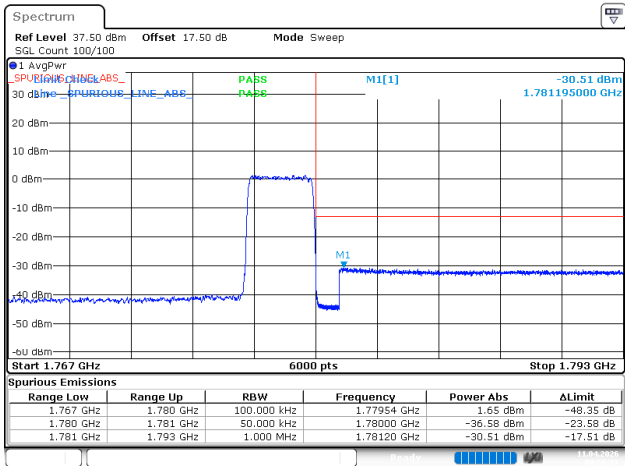


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:56:17

3MHz_High_16QAM_1@14

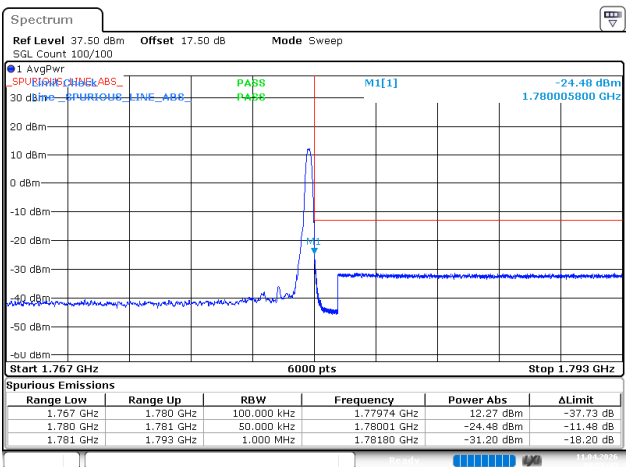


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:56:43

3MHz_High_16QAM_15@0

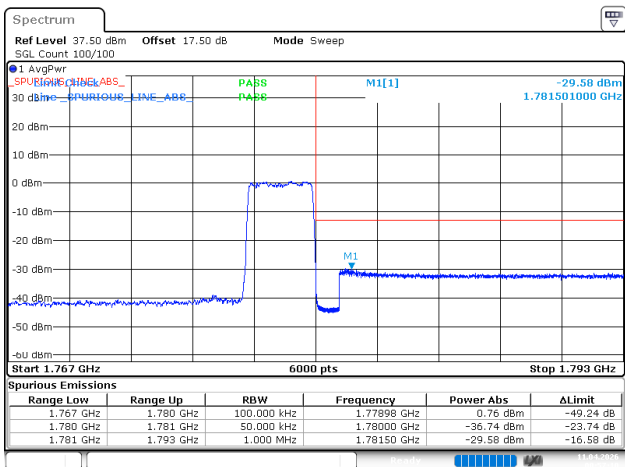


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:57:10

5MHz_Low_QPSK_1@0

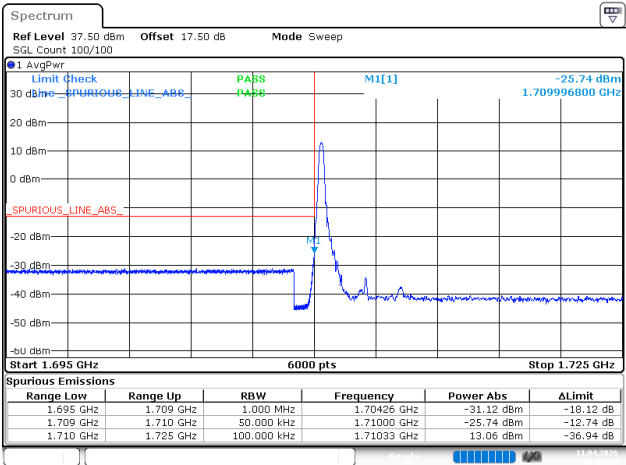


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:58:07

5MHz_Low_QPSK_25@0

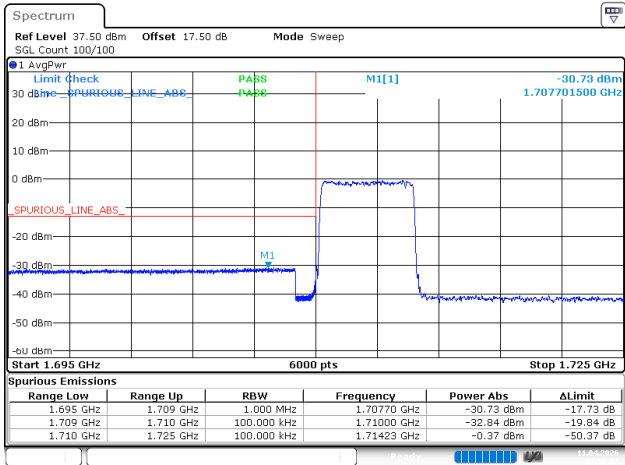


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:58:27

5MHz_Low_16QAM_1@0

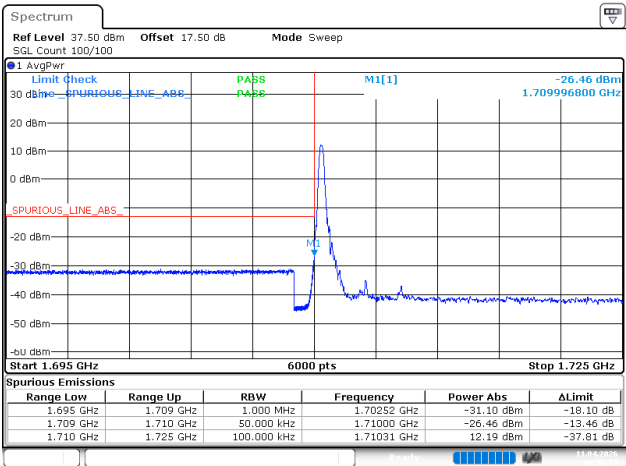


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:58:55

5MHz_Low_16QAM_25@0

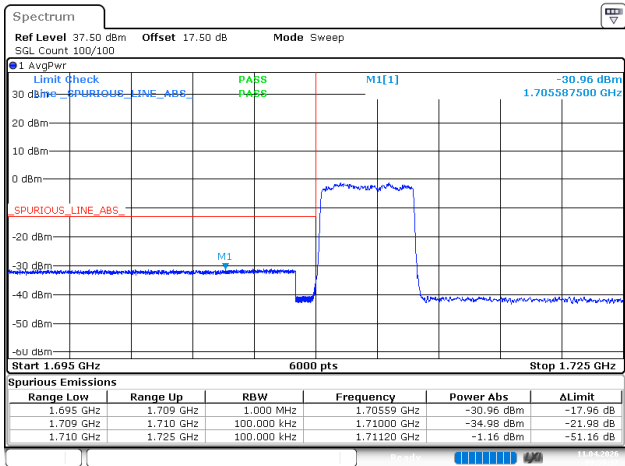


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:59:17

5MHz_High_QPSK_1@24

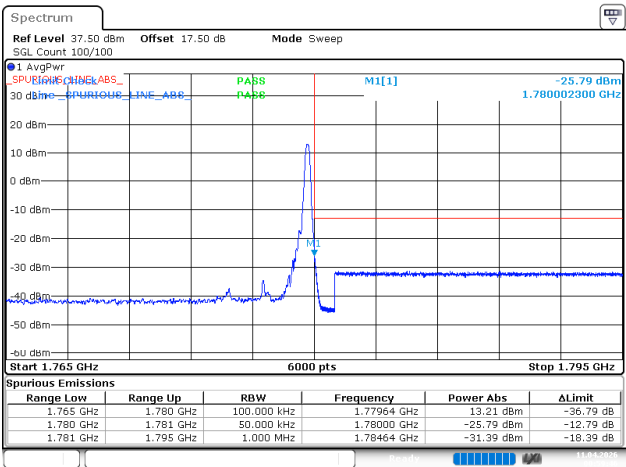


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 00:59:46

5MHz_High_QPSK_25@0

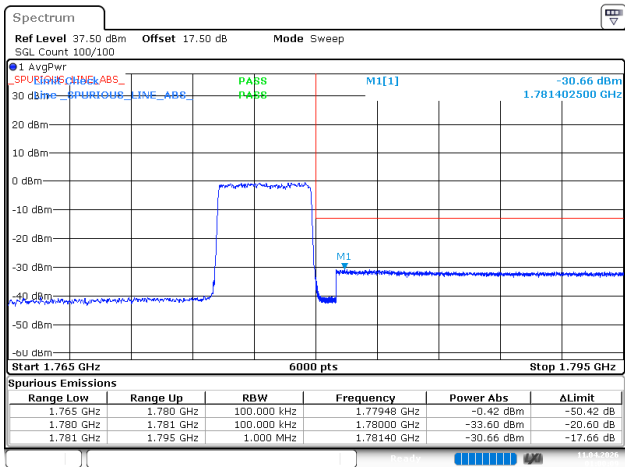


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:00:09

5MHz_High_16QAM_1@24

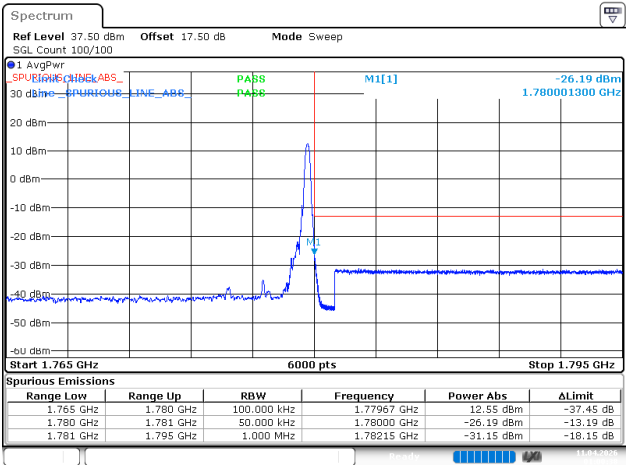


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:00:38

5MHz_High_16QAM_25@0

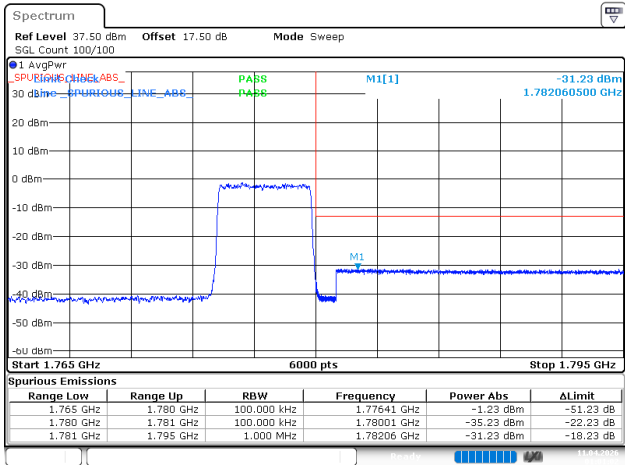


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:01:02

10MHz_Low_QPSK_1@0

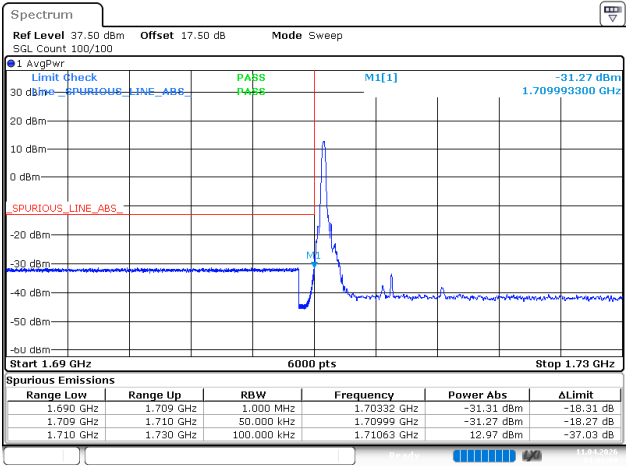


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:02:00

10MHz_Low_QPSK_50@0

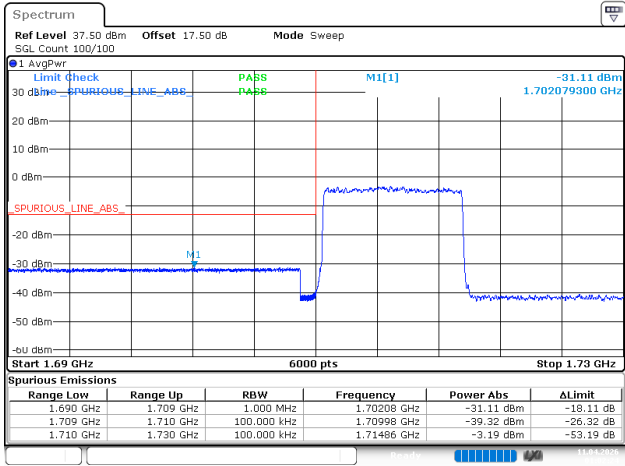


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:02:25

10MHz_Low_16QAM_1@0

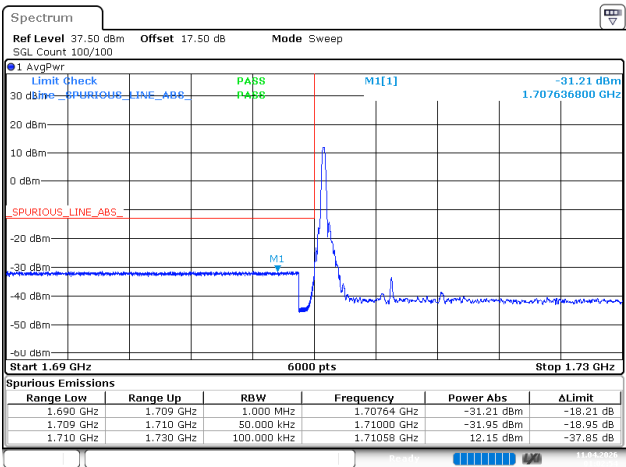


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:02:55

10MHz_Low_16QAM_50@0

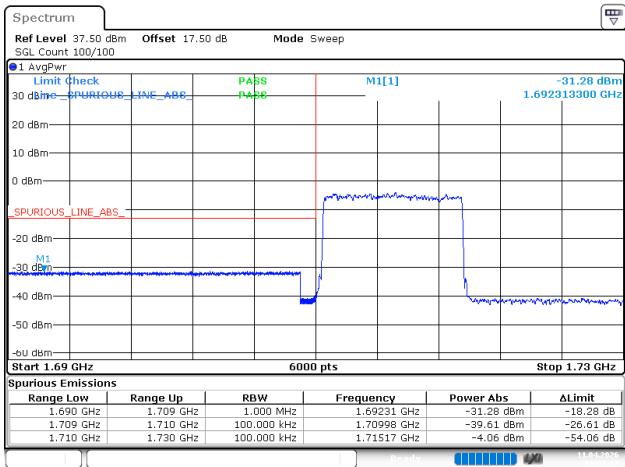


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:03:18

10MHz_High_QPSK_1@49

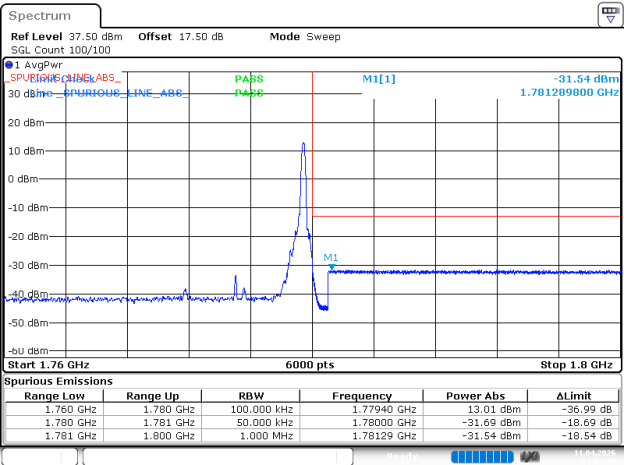


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:03:46

10MHz_High_QPSK_50@0

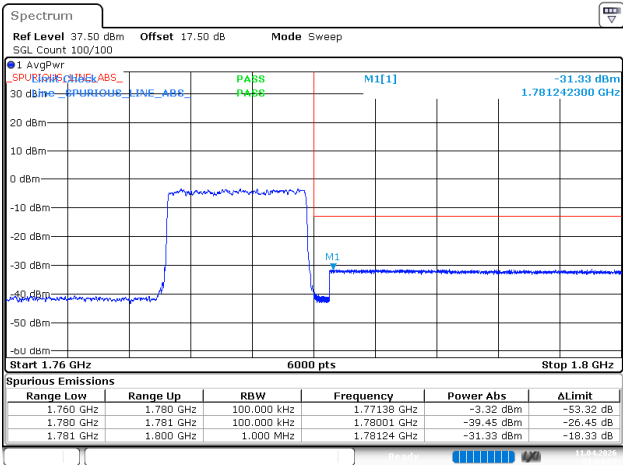


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:04:07

10MHz_High_16QAM_1@49

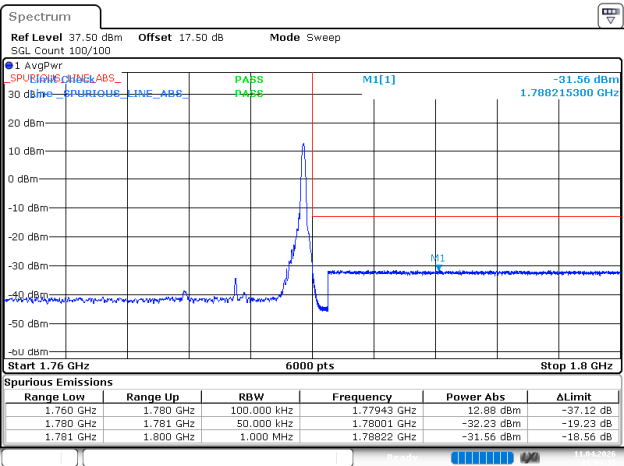


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:04:36

10MHz_High_16QAM_50@0

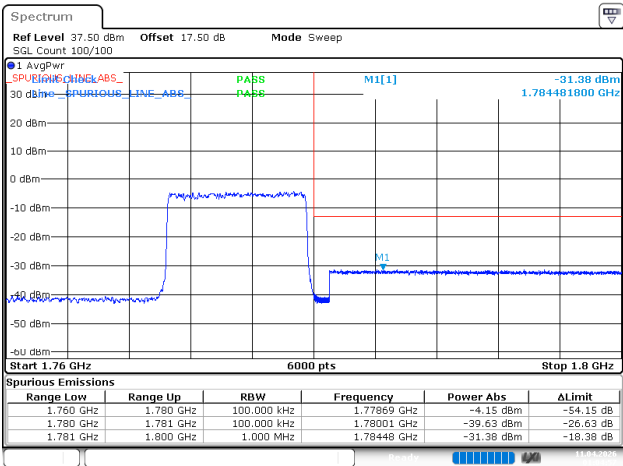


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:04:58

15MHz_Low_QPSK_1@0

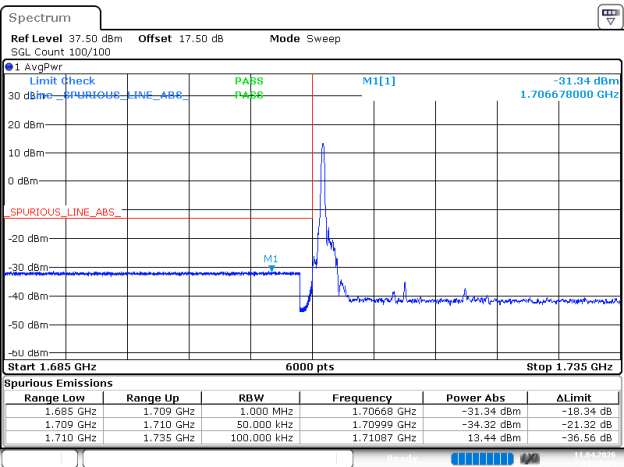


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:05:55

15MHz_Low_QPSK_75@0

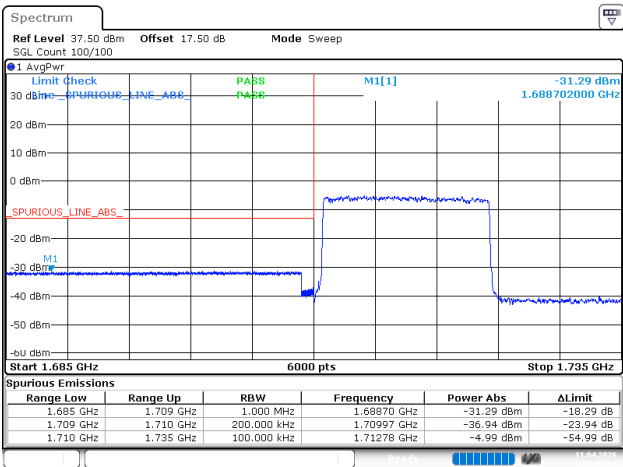


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:06:15

15MHz_Low_16QAM_1@0

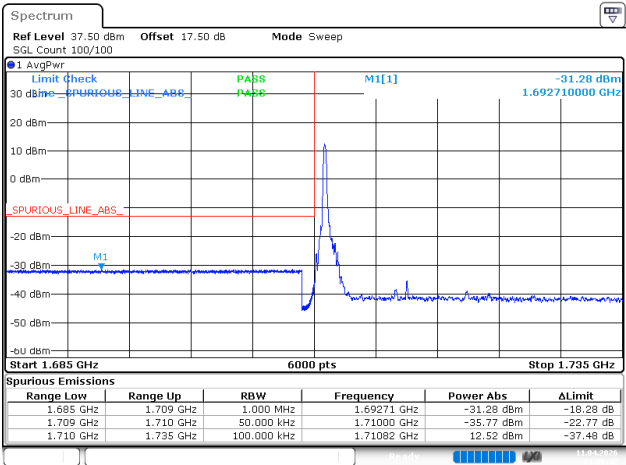


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:06:42

15MHz_Low_16QAM_75@0

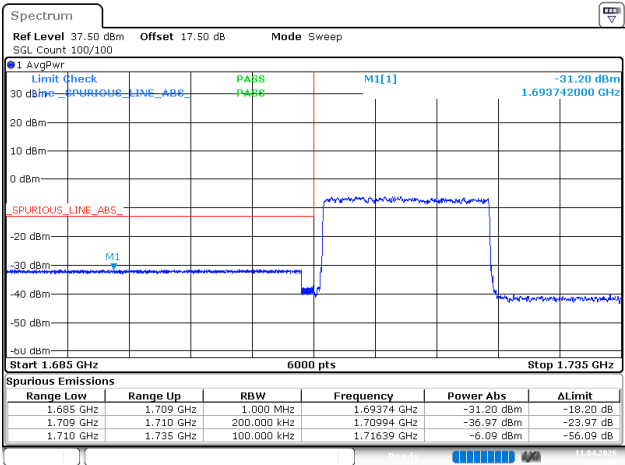


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 01:07:03

15MHz_High_QPSK_1@74

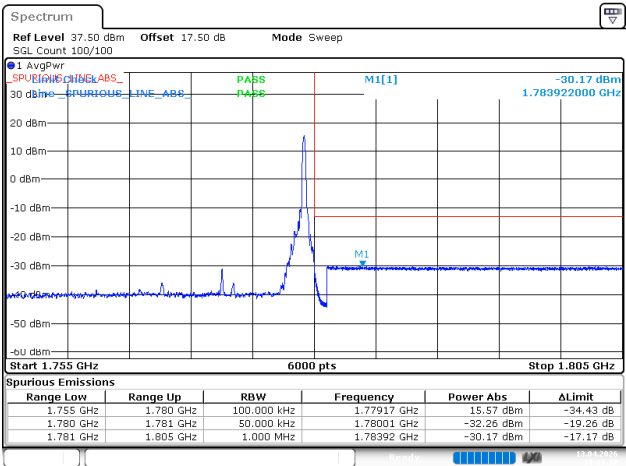


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:19:37

15MHz_High_QPSK_75@0

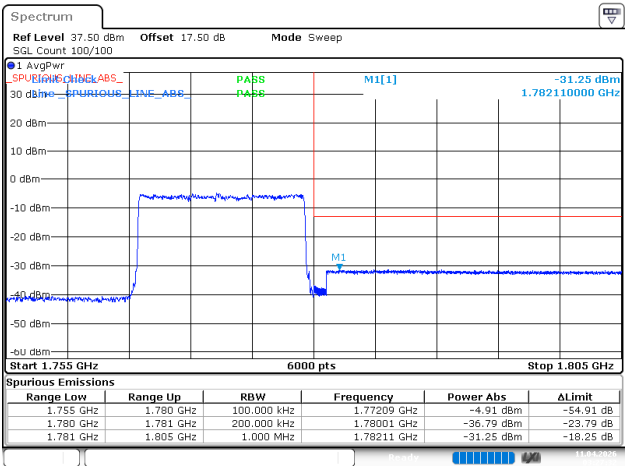


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 03:27:32

15MHz_High_16QAM_1@74

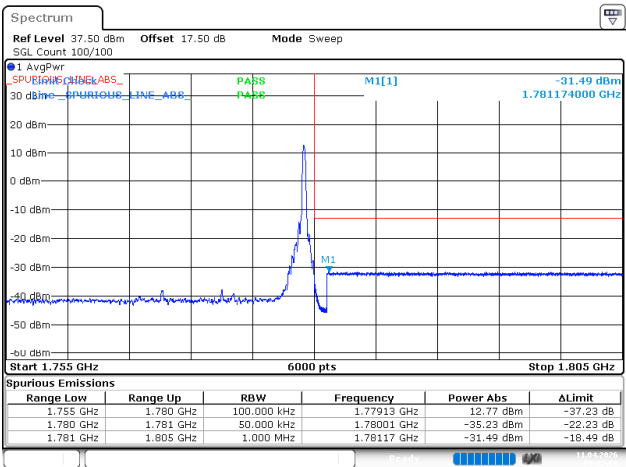


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 03:27:59

15MHz_High_16QAM_75@0

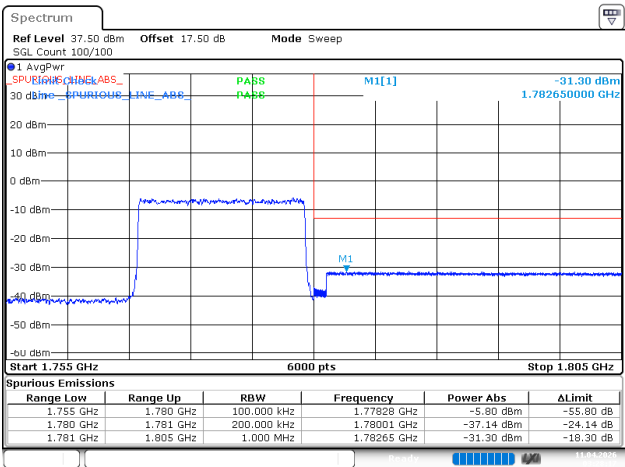


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 03:28:17

20MHz_Low_QPSK_1@0

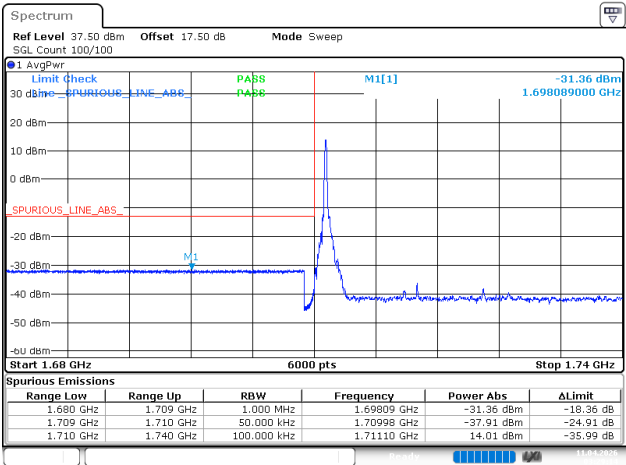


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 03:29:14

20MHz_Low_QPSK_100@0

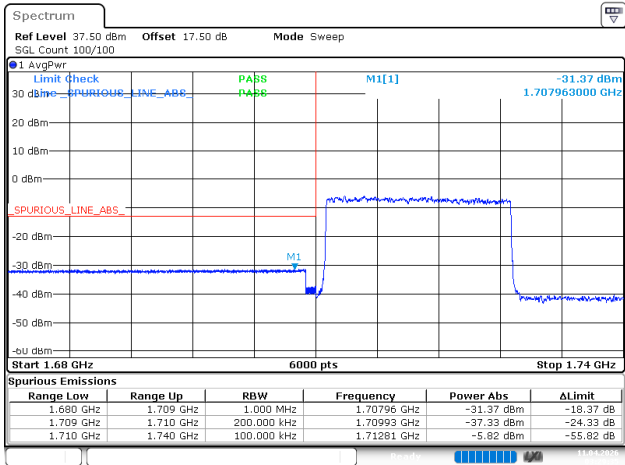


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 03:29:35

20MHz_Low_16QAM_1@0

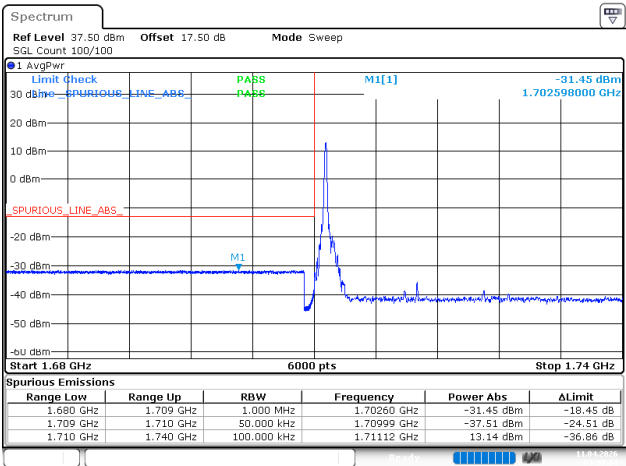


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 03:30:05

20MHz_Low_16QAM_100@0

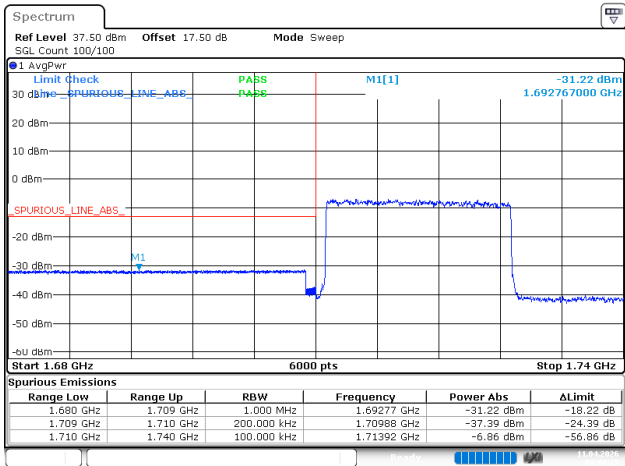


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 03:30:26

20MHz_High_QPSK_1@99

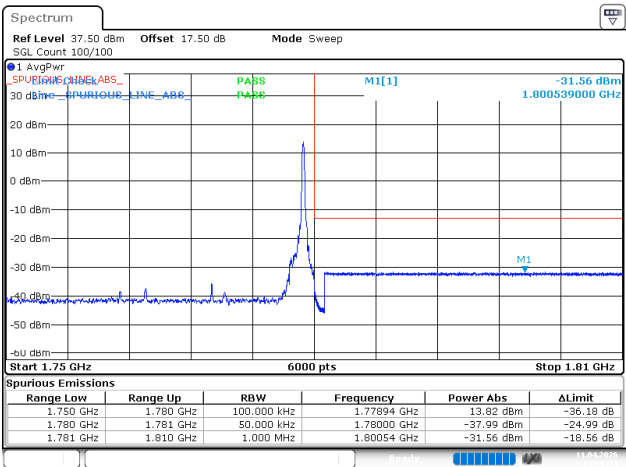

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 03:30:55



20MHz_High_QPSK_100@0

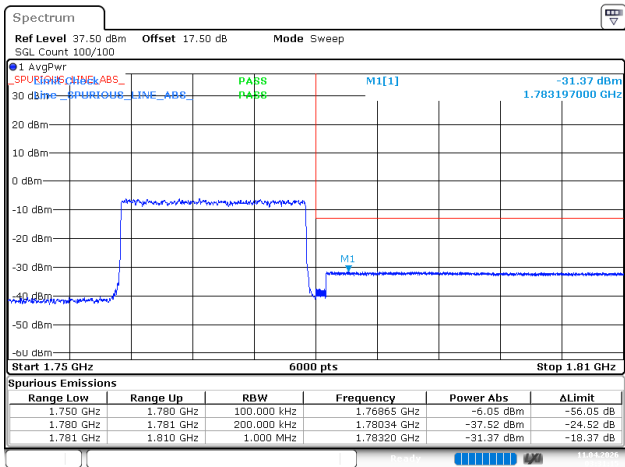

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 03:31:16

20MHz_High_16QAM_1@99



20MHz_High_16QAM_100@0

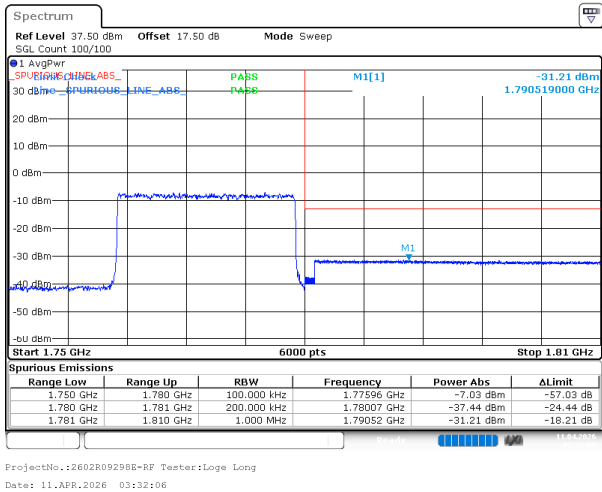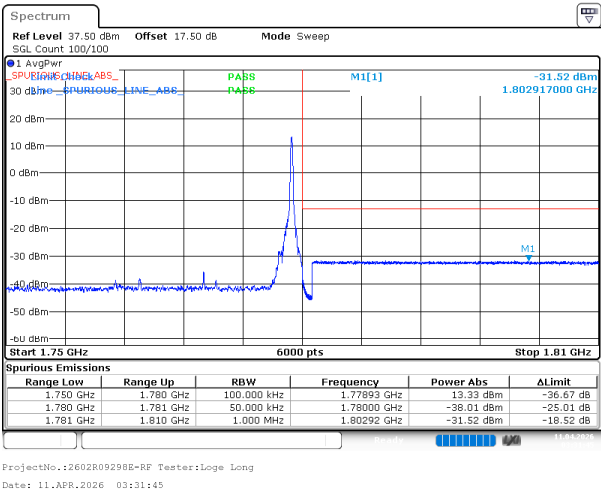

LTE B42_1, Normal



5MHz_Low_QPSK_1@0

5MHz_Low_QPSK_25@0

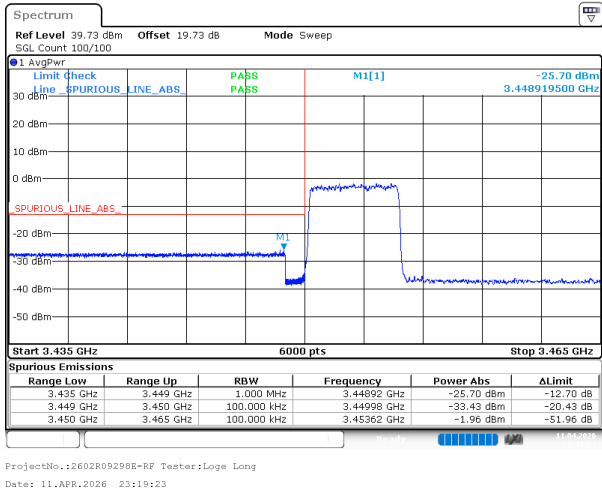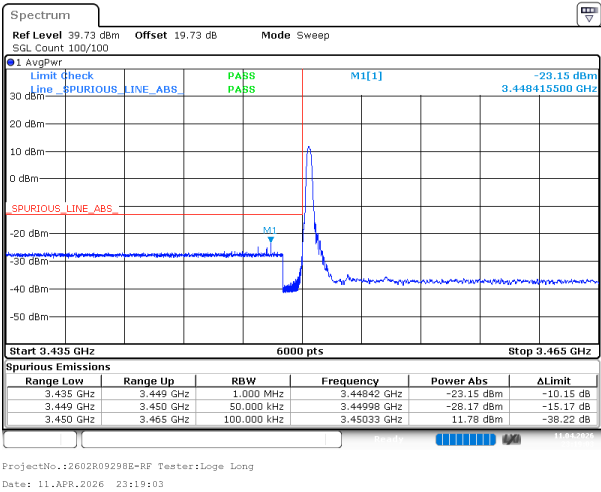


5MHz_Low_16QAM_1@0

5MHz_Low_16QAM_25@0

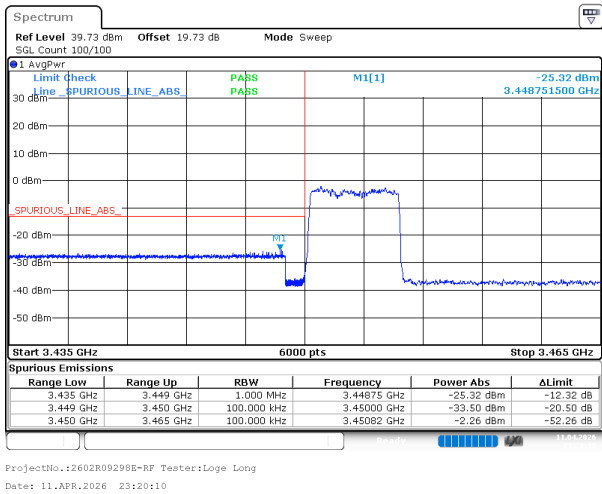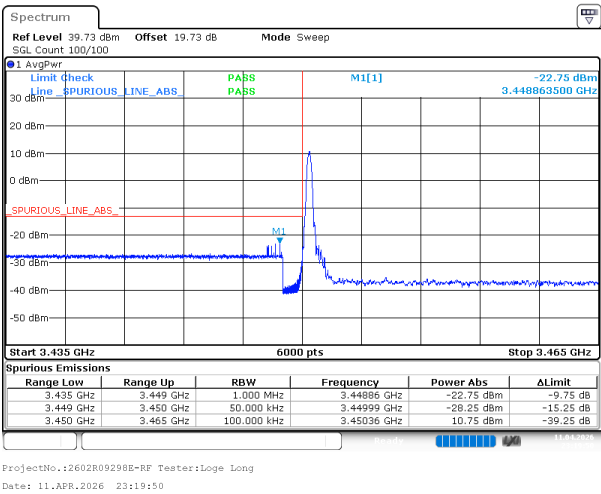


5MHz_High_QPSK_1@24

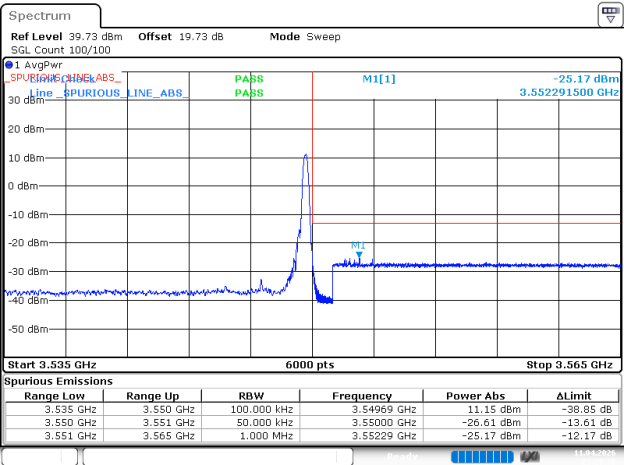


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:20:36

5MHz_High_QPSK_25@0

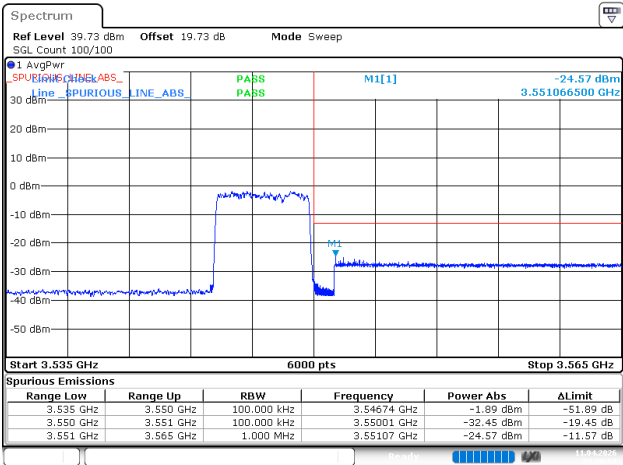


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:20:57

5MHz_High_16QAM_1@24

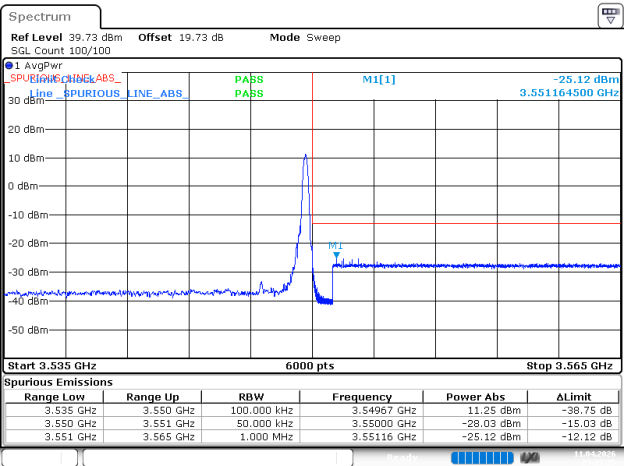


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:21:25

5MHz_High_16QAM_25@0

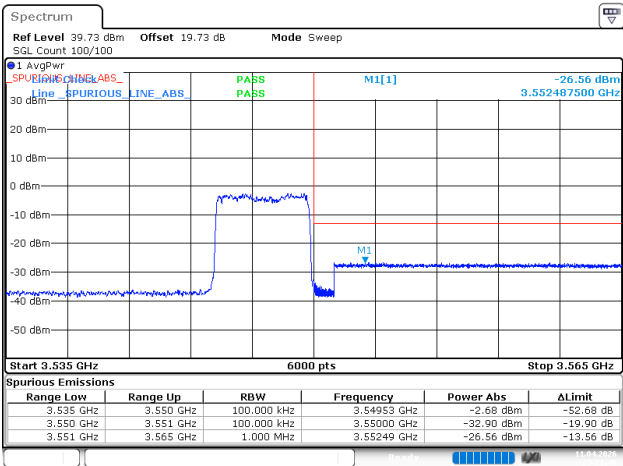


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:21:46

10MHz_Low_QPSK_1@0

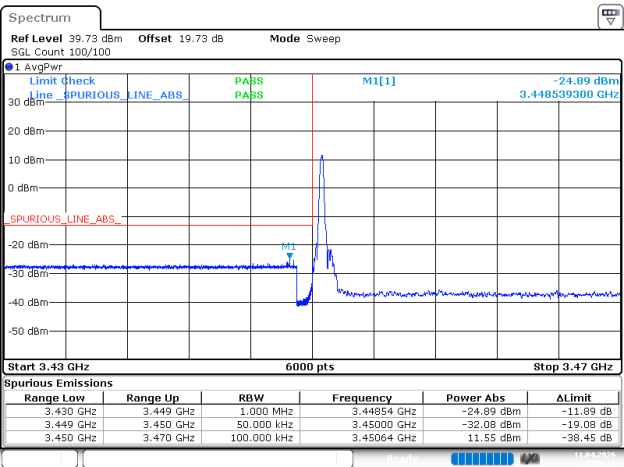


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:22:18

10MHz_Low_QPSK_50@0

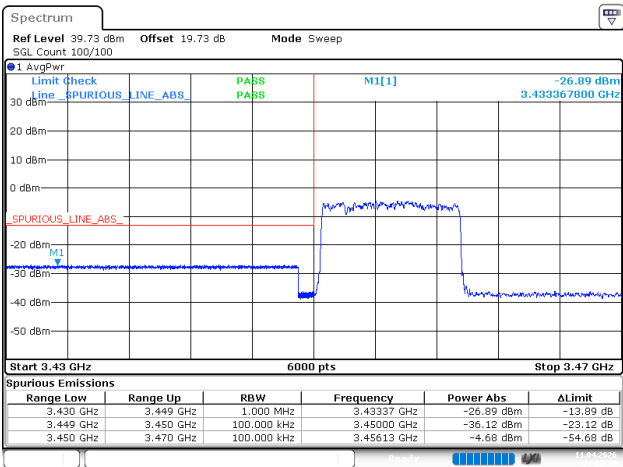


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:22:39

10MHz_Low_16QAM_1@0

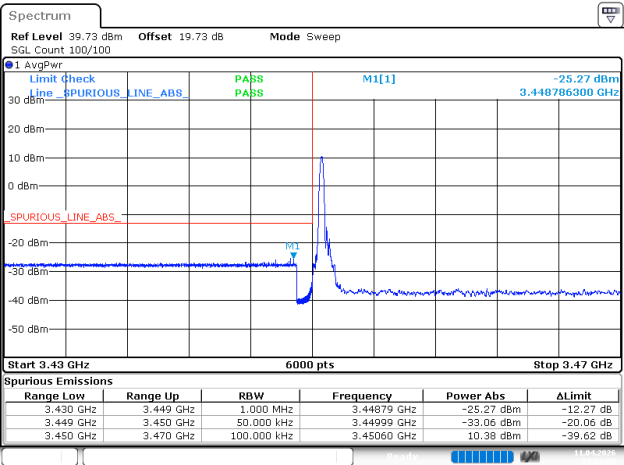


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:23:07

10MHz_Low_16QAM_50@0

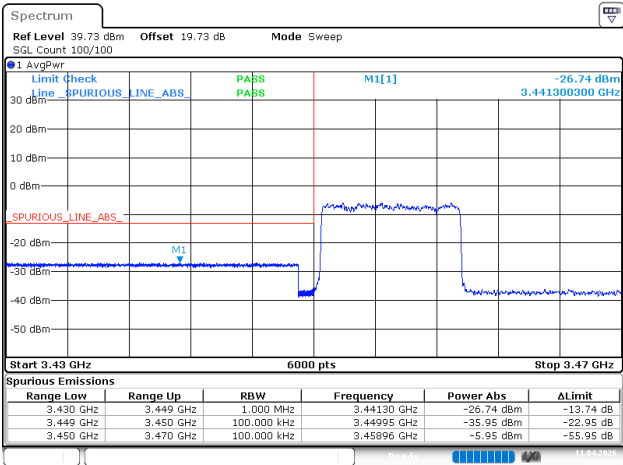


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:23:29

10MHz_High_QPSK_1@49

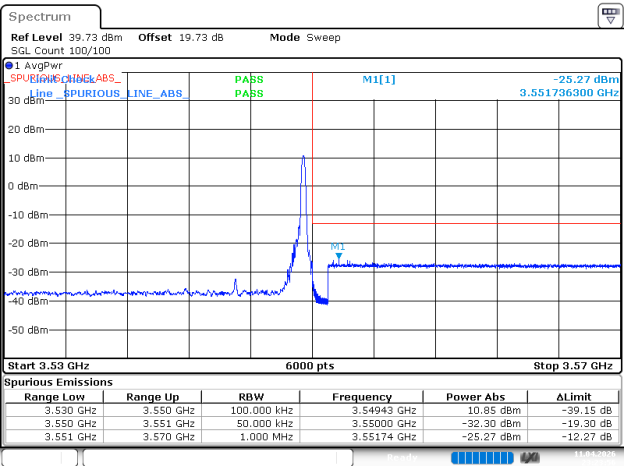


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:23:56

10MHz_High_QPSK_50@0

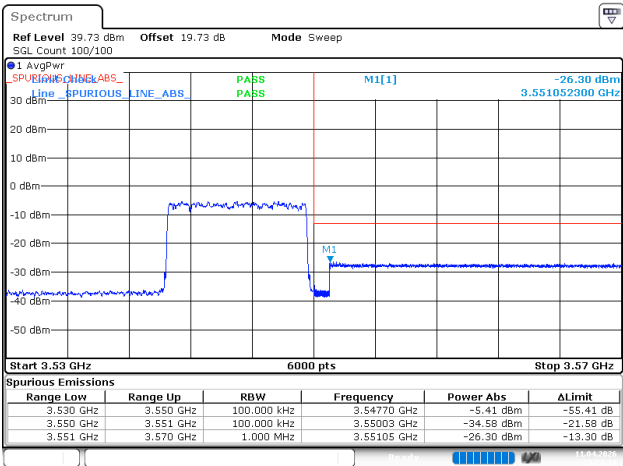


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:24:10

10MHz_High_16QAM_1@49

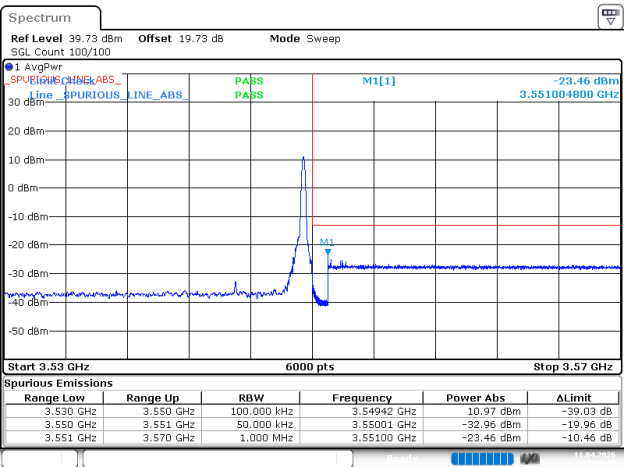


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:24:45

10MHz_High_16QAM_50@0

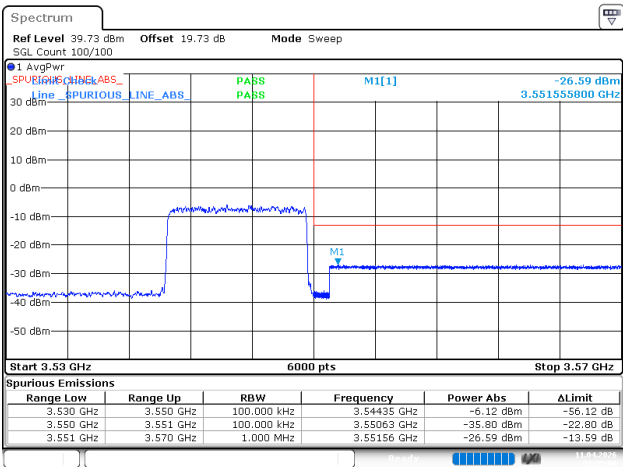


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:25:06

15MHz_Low_QPSK_1@0

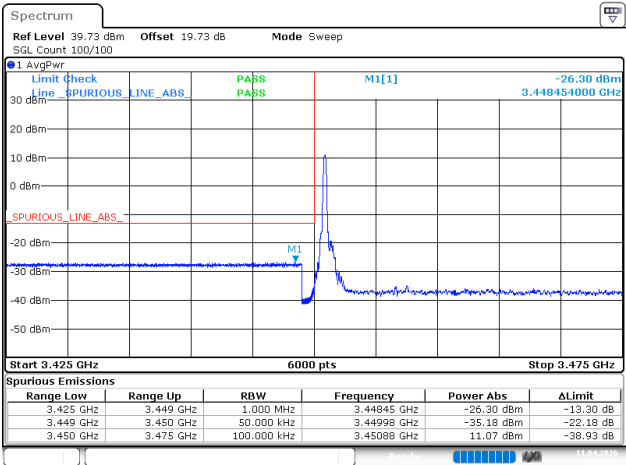


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:25:38

15MHz_Low_QPSK_75@0

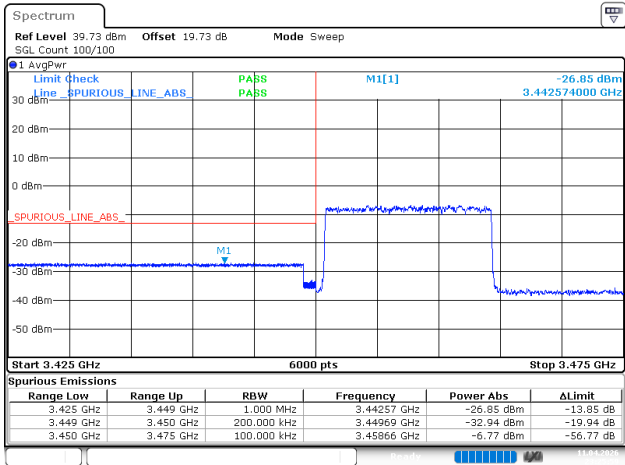


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:25:59

15MHz_Low_16QAM_1@0

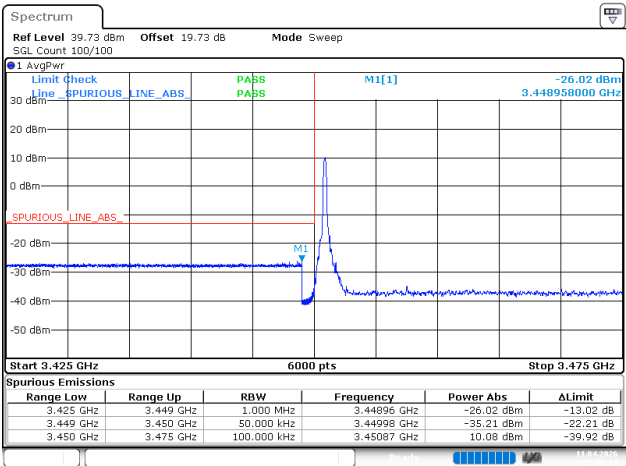


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:26:28

15MHz_Low_16QAM_75@0

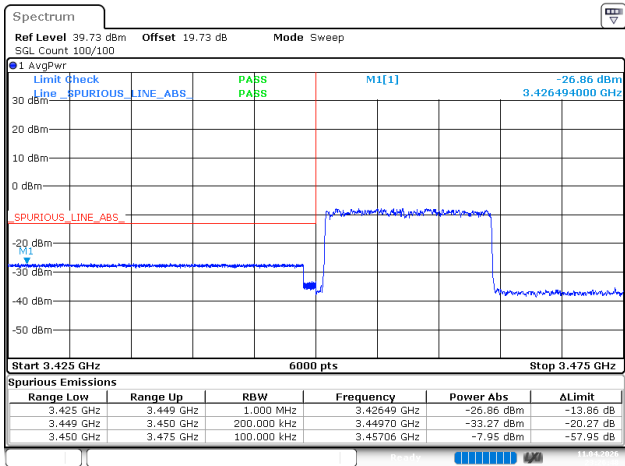


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:26:48

15MHz_High_QPSK_1@74

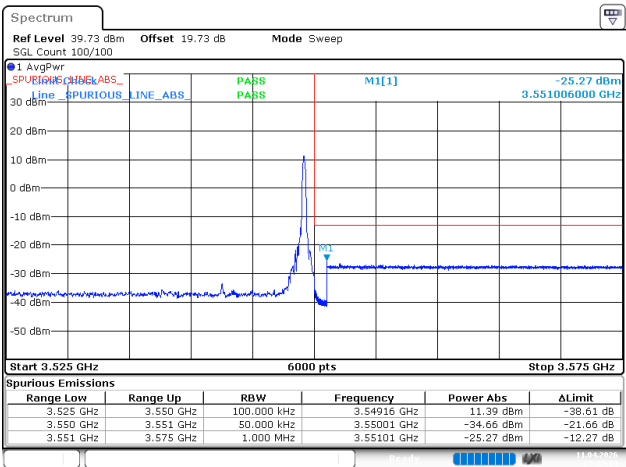


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:27:14

15MHz_High_QPSK_75@0

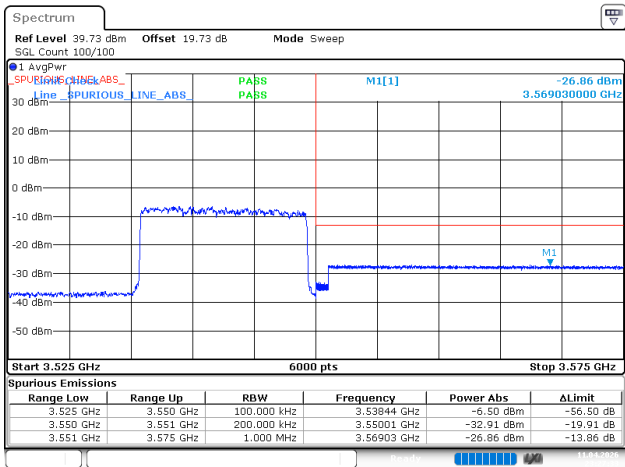


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:27:33

15MHz_High_16QAM_1@74

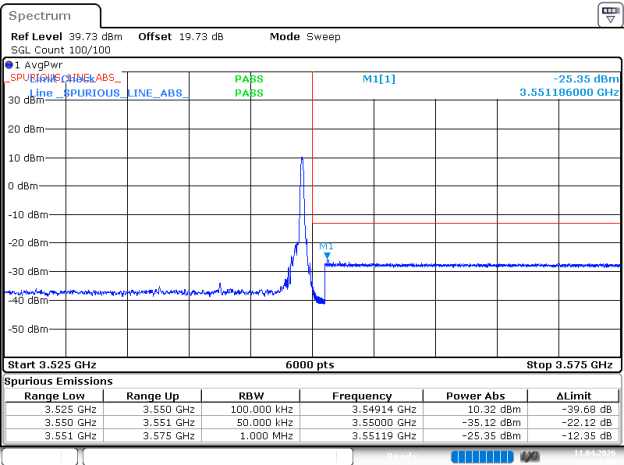


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:28:00

15MHz_High_16QAM_75@0

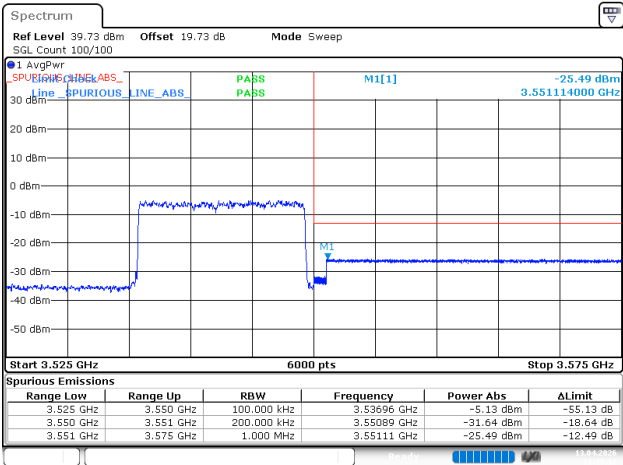


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:43:13

20MHz_Low_QPSK_1@0

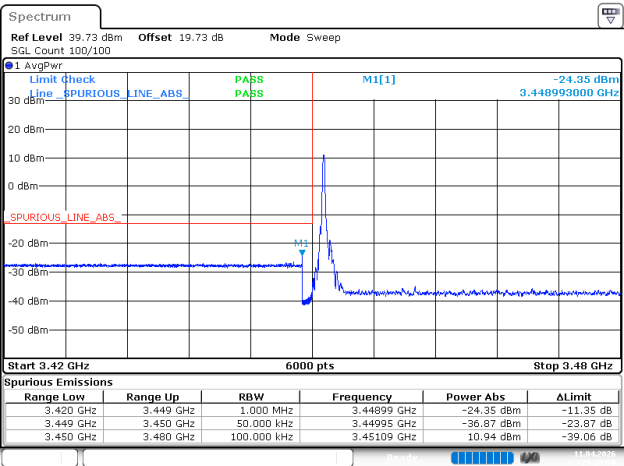


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:28:50

20MHz_Low_QPSK_100@0

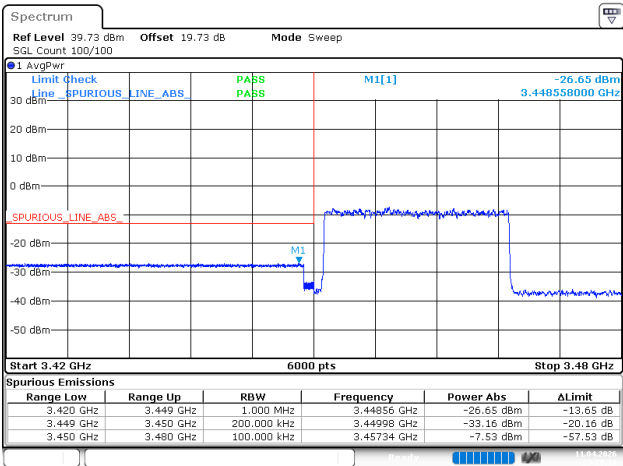


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:29:10

20MHz_Low_16QAM_1@0

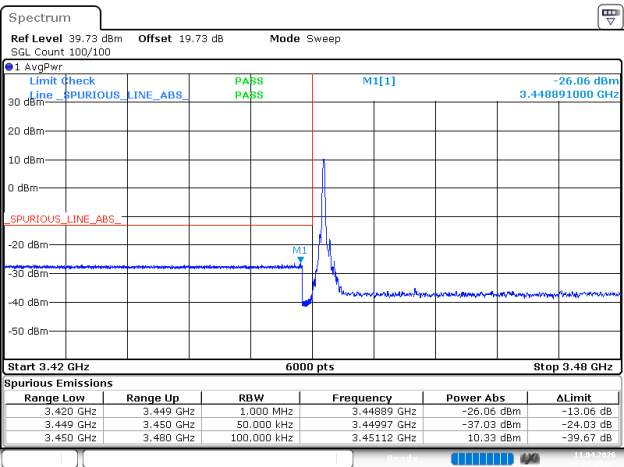


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:29:37

20MHz_Low_16QAM_100@0

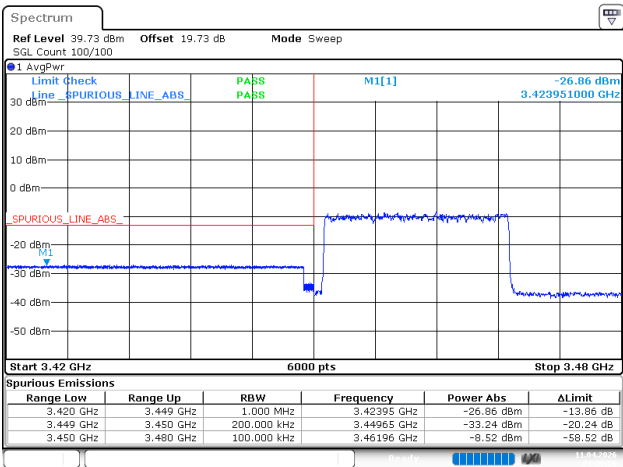


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:29:56

20MHz_High_QPSK_1@99

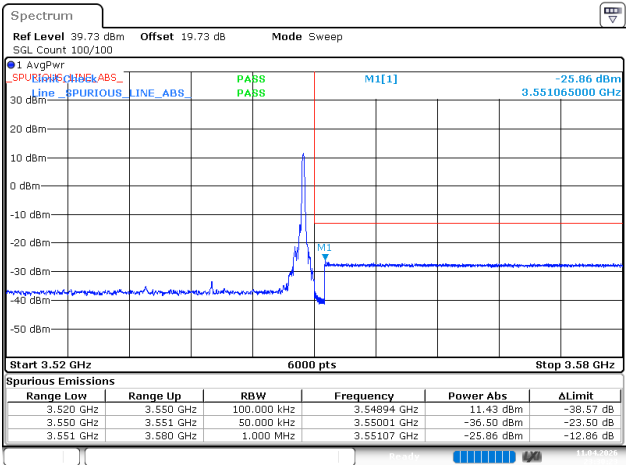


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:30:23

20MHz_High_QPSK_100@0

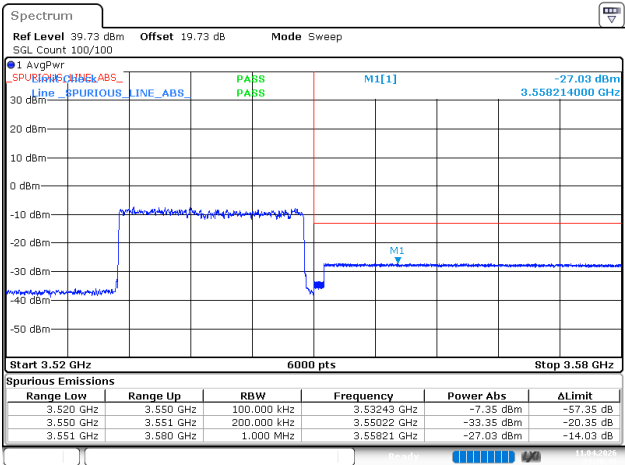


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:30:43

20MHz_High_16QAM_1@99

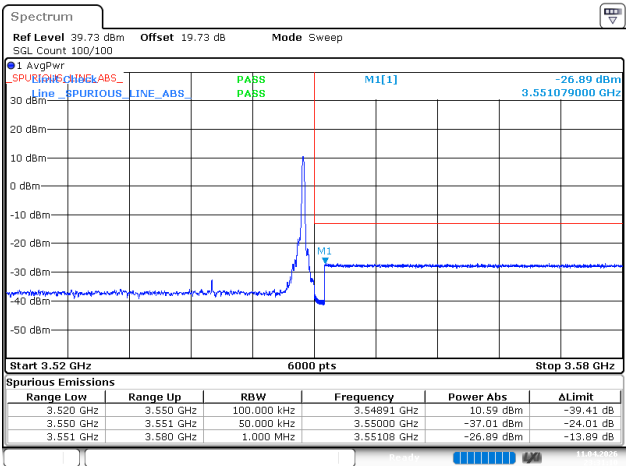

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:31:10

20MHz_High_16QAM_100@0

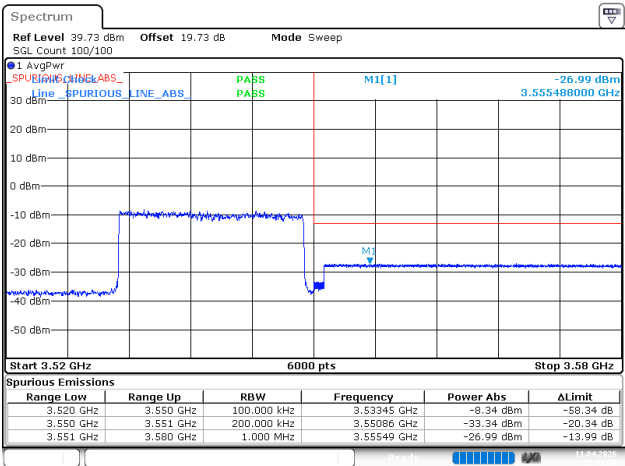

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:31:30

Duty Cycle

FCC Part 27

LTE Band 38, Normal

Mode	Ton (ms)	Ton+Toff (ms)	Duty Cycle (%)	Duty Cycle Factor(dB)
5MHz_Middle_QPSK_25@0	2.993	5.001	59.85	2.23
5MHz_Middle_16QAM_25@0	2.993	5.001	59.85	2.23
10MHz_Middle_QPSK_50@0	2.993	5.001	59.85	2.23
10MHz_Middle_16QAM_50@0	2.996	5.001	59.90	2.23
15MHz_Middle_QPSK_75@0	2.993	5.001	59.85	2.23
15MHz_Middle_16QAM_75@0	2.991	5.001	59.80	2.23
20MHz_Middle_QPSK_100@0	2.993	5.001	59.85	2.23
20MHz_Middle_16QAM_100@0	2.996	5.001	59.90	2.23

LTE Band 41, Normal

Mode	Ton (ms)	Ton+Toff (ms)	Duty Cycle (%)	Duty Cycle Factor(dB)
5MHz_Middle_QPSK_25@0	2.993	5.001	59.85	2.23
5MHz_Middle_16QAM_25@0	2.996	5.001	59.90	2.23
10MHz_Middle_QPSK_50@0	2.993	5.001	59.85	2.23
10MHz_Middle_16QAM_50@0	2.993	5.001	59.85	2.23
15MHz_Middle_QPSK_75@0	2.993	5.001	59.85	2.23
15MHz_Middle_16QAM_75@0	2.996	5.001	59.90	2.23
20MHz_Middle_QPSK_100@0	2.993	5.001	59.85	2.23
20MHz_Middle_16QAM_100@0	2.996	5.001	59.90	2.23


LTE B42_1, Normal

Mode	Ton (ms)	Ton+Toff (ms)	Duty Cycle (%)	Duty Cycle Factor(dB)
5MHz_Middle_QPSK_25@0	2.996	5.001	59.90	2.23
5MHz_Middle_16QAM_25@0	2.993	5.001	59.85	2.23
10MHz_Middle_QPSK_50@0	2.996	5.001	59.90	2.23
10MHz_Middle_16QAM_50@0	2.993	5.001	59.85	2.23
15MHz_Middle_QPSK_75@0	2.996	5.001	59.90	2.23
15MHz_Middle_16QAM_75@0	2.993	5.001	59.85	2.23
20MHz_Middle_QPSK_100@0	2.996	5.001	59.90	2.23
20MHz_Middle_16QAM_100@0	2.996	5.001	59.90	2.23


Duty Cycle = Ton/(Ton+Toff)*100%

LTE Band 38, Normal


5MHz_Middle_QPSK_25@0

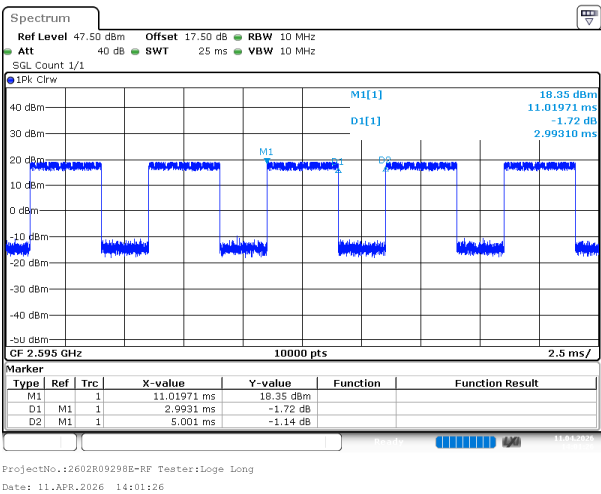


5MHz_Middle_16QAM_25@0

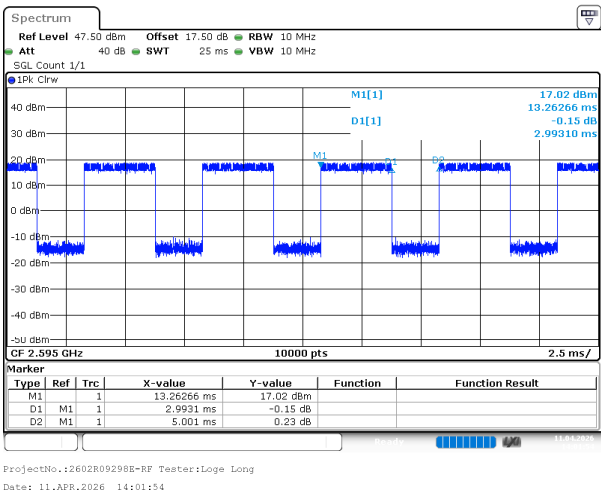


10MHz_Middle_QPSK_50@0

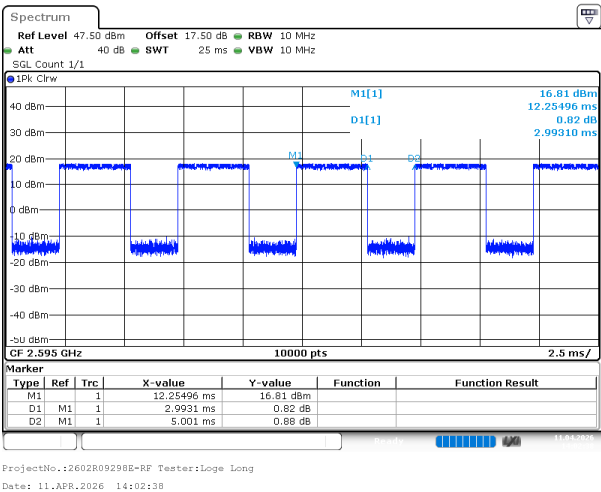


10MHz_Middle_16QAM_50@0

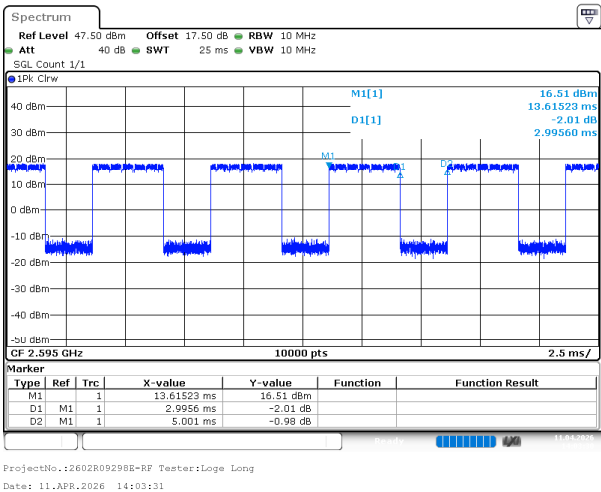


15MHz_Middle_QPSK_75@0

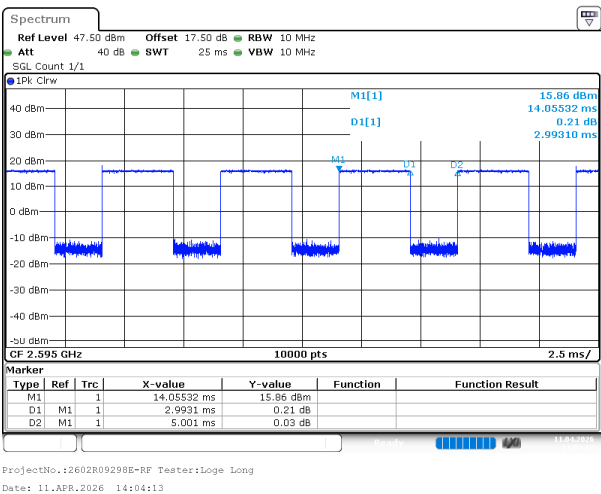


15MHz_Middle_16QAM_75@0

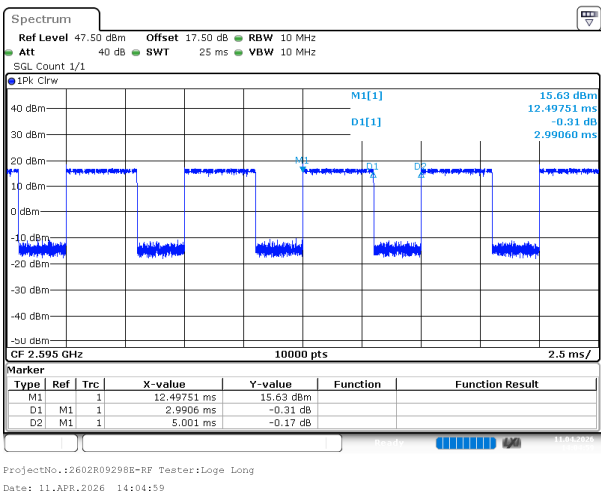

20MHz_Middle_QPSK_100@0

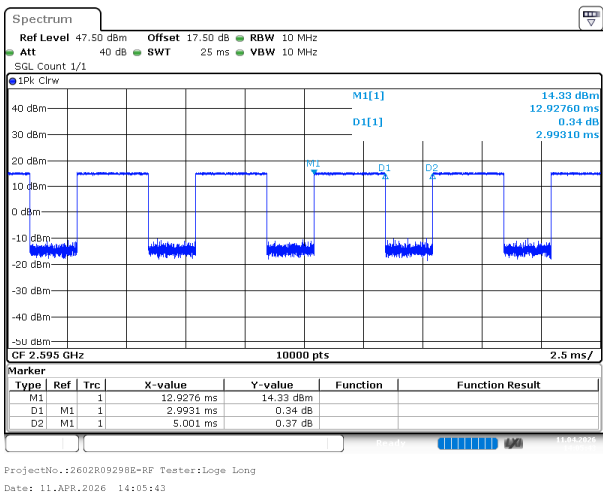


20MHz_Middle_16QAM_100@0

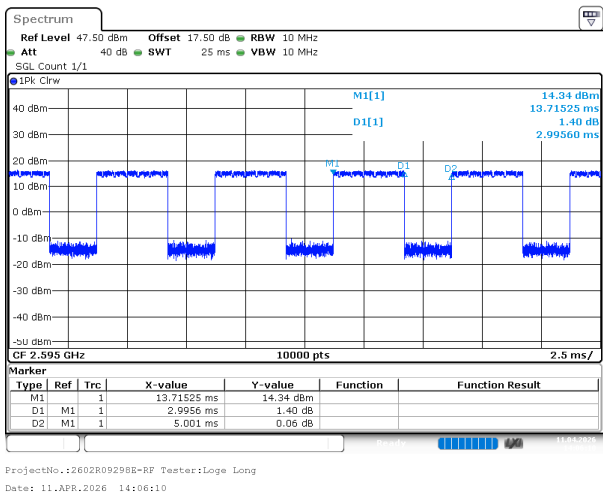


LTE Band 41, Normal


5MHz_Middle_QPSK_25@0

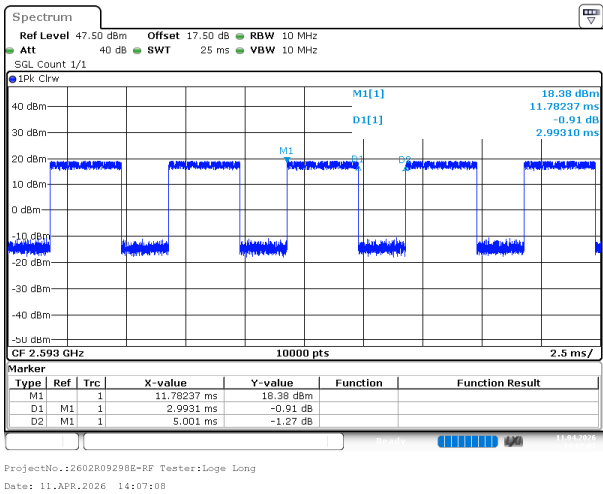


5MHz_Middle_16QAM_25@0

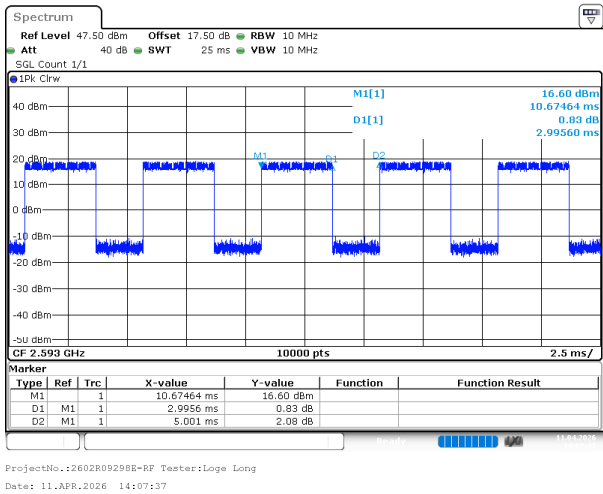


10MHz_Middle_QPSK_50@0

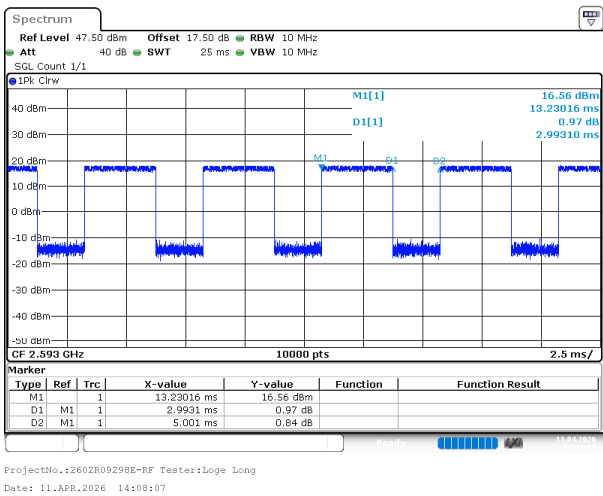


10MHz_Middle_16QAM_50@0

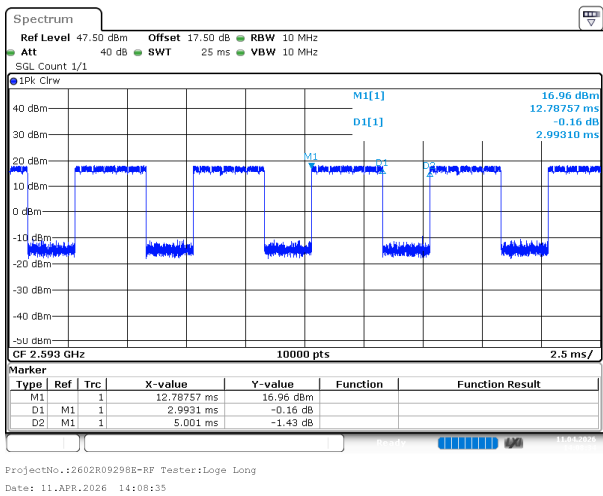


15MHz_Middle_QPSK_75@0

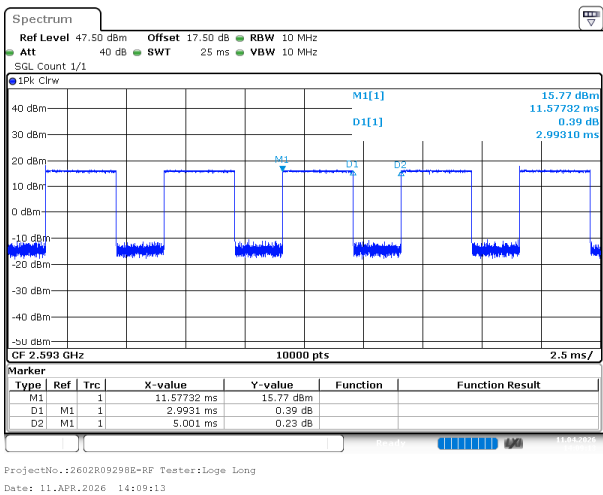


15MHz_Middle_16QAM_75@0

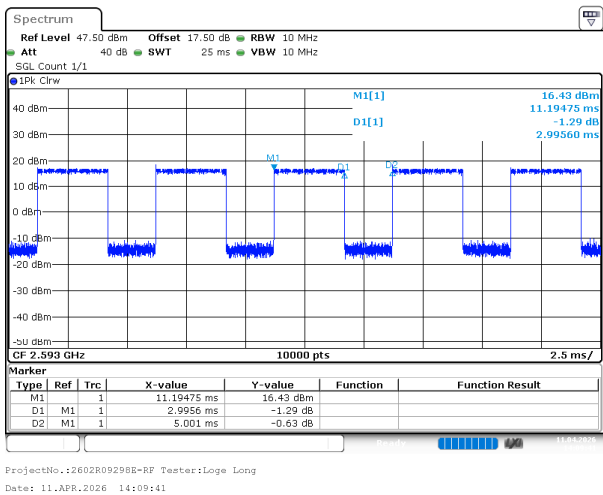

20MHz_Middle_QPSK_100@0

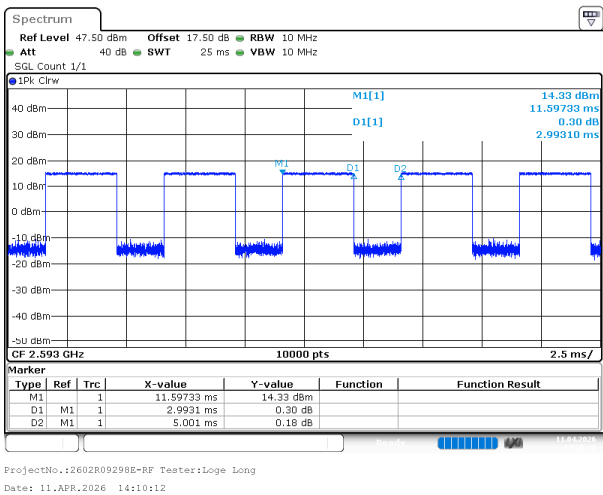


20MHz_Middle_16QAM_100@0

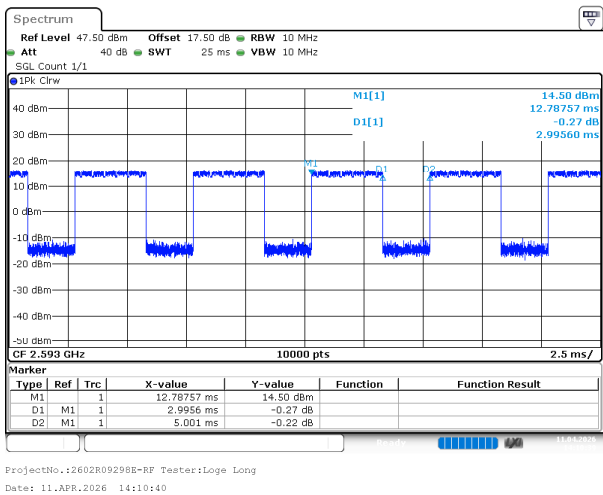


LTE B42_1, Normal


5MHz_Middle_QPSK_25@0

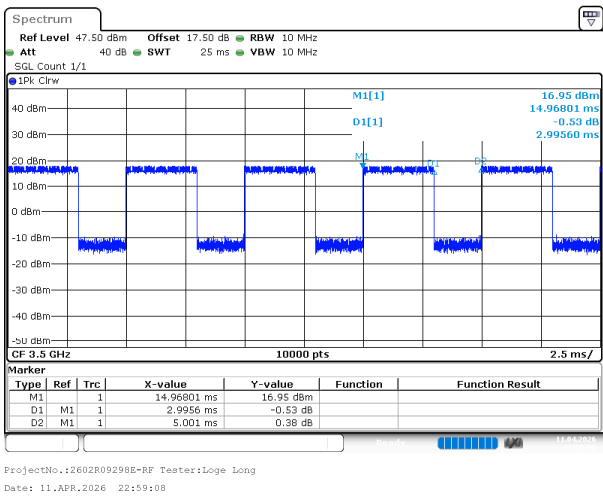

5MHz_Middle_16QAM_25@0

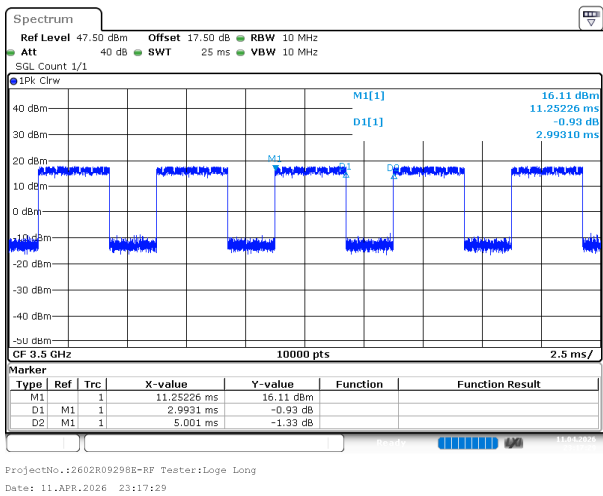


10MHz_Middle_QPSK_50@0

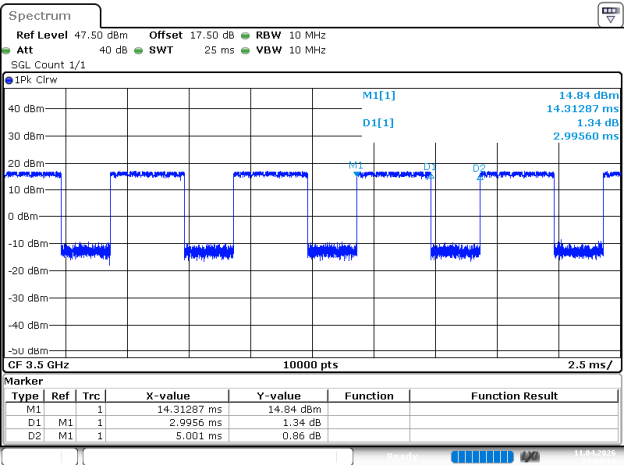


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:01:19

10MHz_Middle_16QAM_50@0

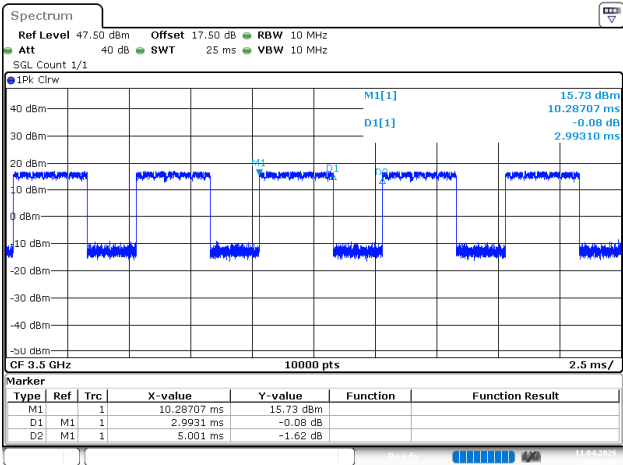


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:01:40

15MHz_Middle_QPSK_75@0

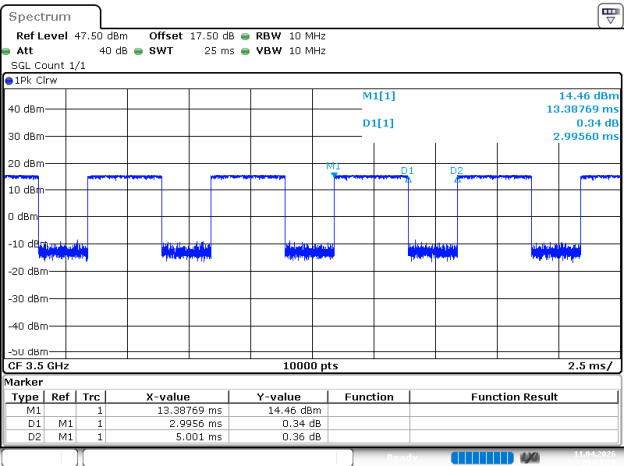


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:02:20

15MHz_Middle_16QAM_75@0

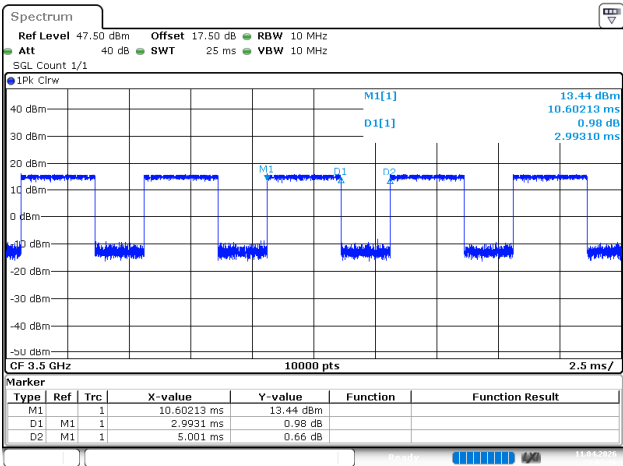


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:03:16

20MHz_Middle_QPSK_100@0

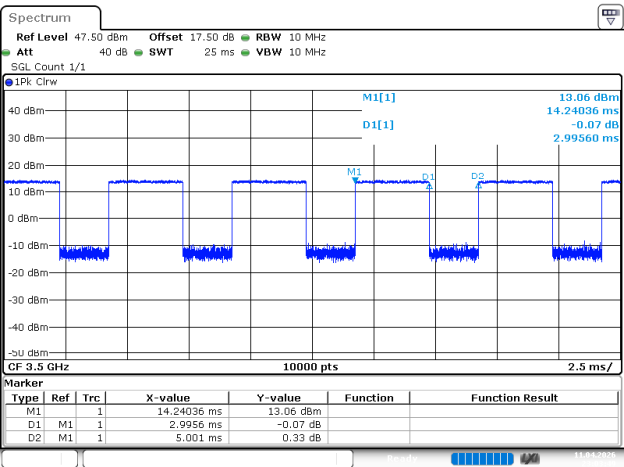

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:03:49

20MHz_Middle_16QAM_100@0

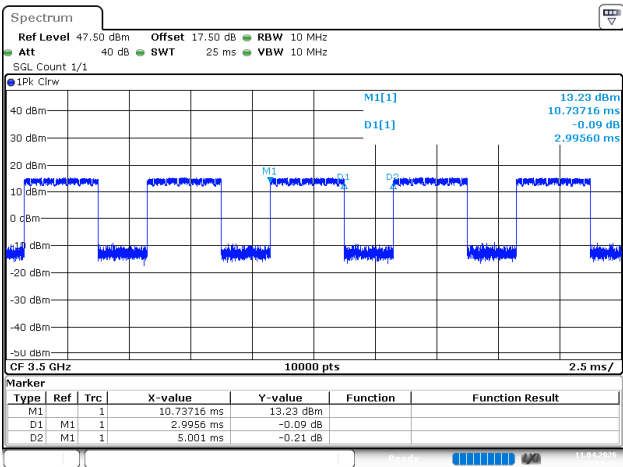


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 23:04:16

Spurious Emissions at Antenna Terminal


FCC Part 22H

LTE Band 5, Normal
1RB was the worst case


1.4MHz_Low_QPSK_1@(30MHz~9.49GHz)

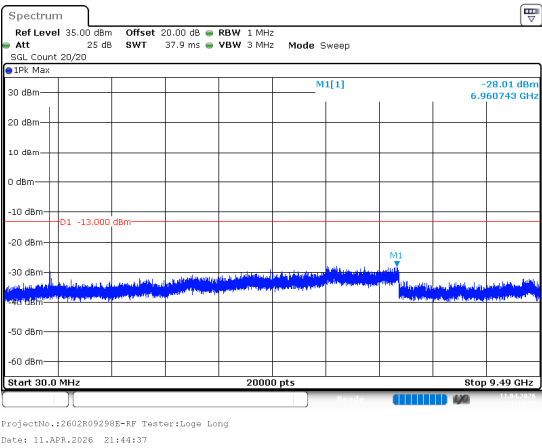


1.4MHz_Middle_QPSK_1@(30MHz~9.49GHz)

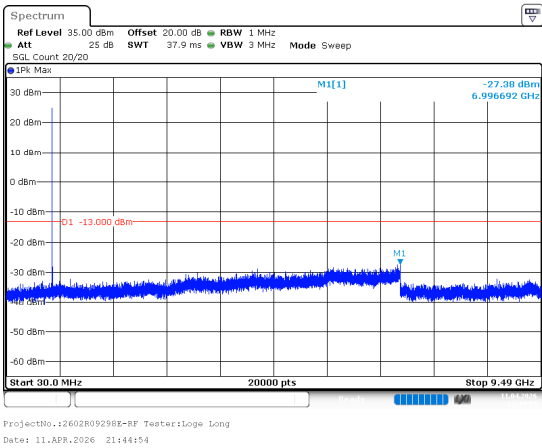


1.4MHz_High_QPSK_1@(30MHz~9.49GHz)

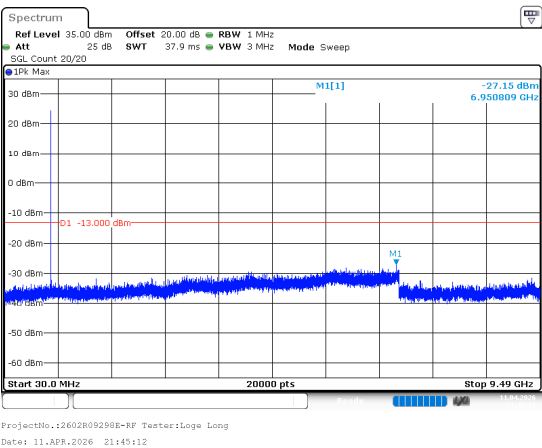


3MHz_Low_QPSK_1@(30MHz~9.49GHz)

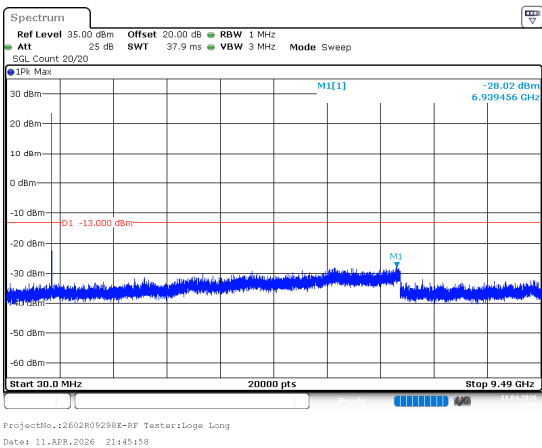


3MHz_Middle_QPSK_1@(30MHz~9.49GHz)

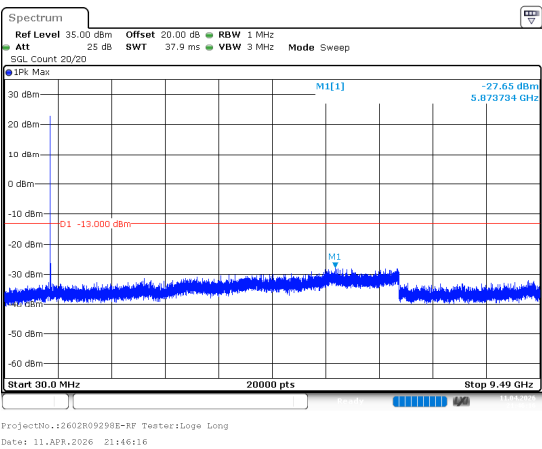

3MHz_High_QPSK_1@(30MHz~9.49GHz)

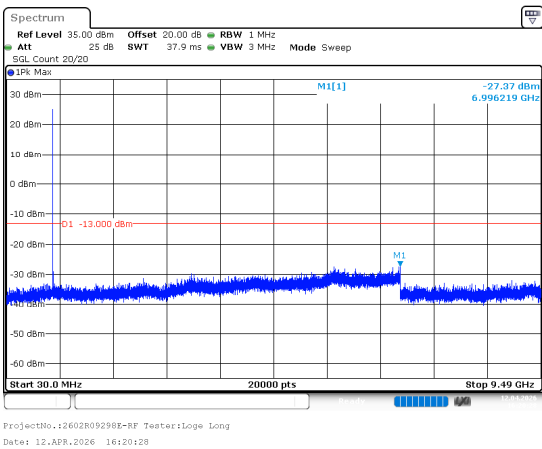


5MHz_Low_QPSK_1@0(30MHz~9.49GHz)

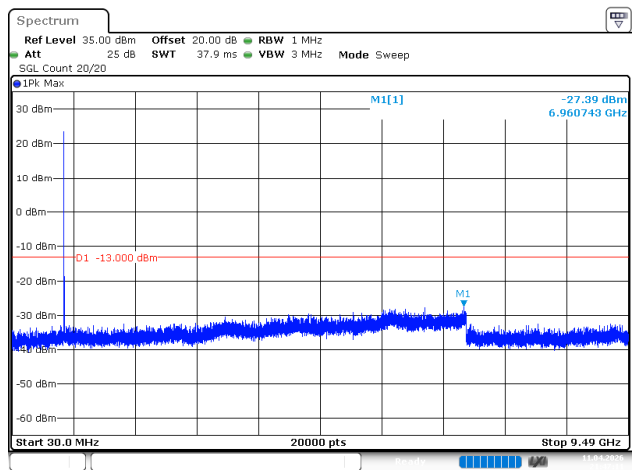


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:47:11

5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

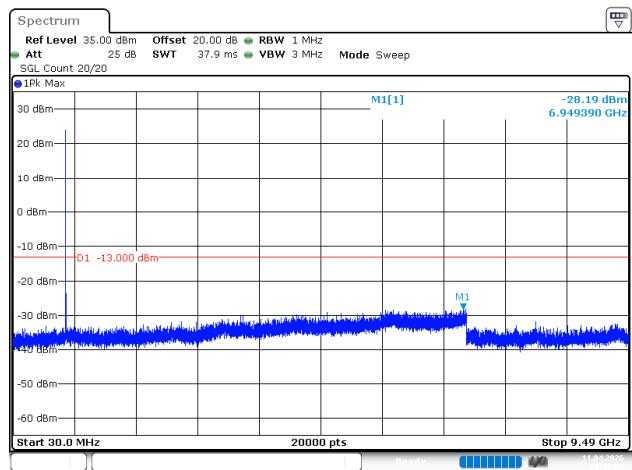


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:47:29

5MHz_High_QPSK_1@0(30MHz~9.49GHz)

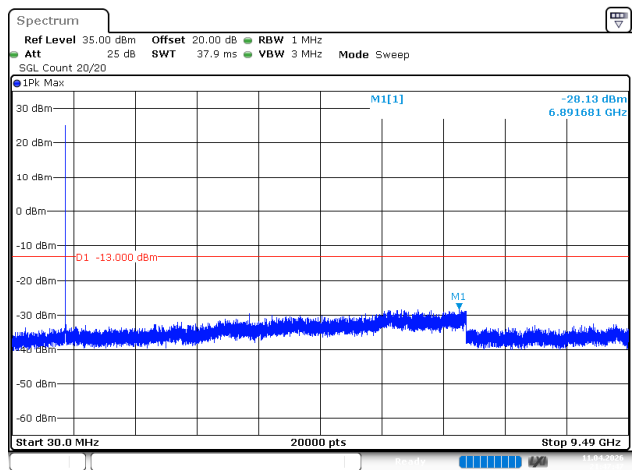


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:47:47

10MHz_Low_QPSK_1@0(30MHz~9.49GHz)

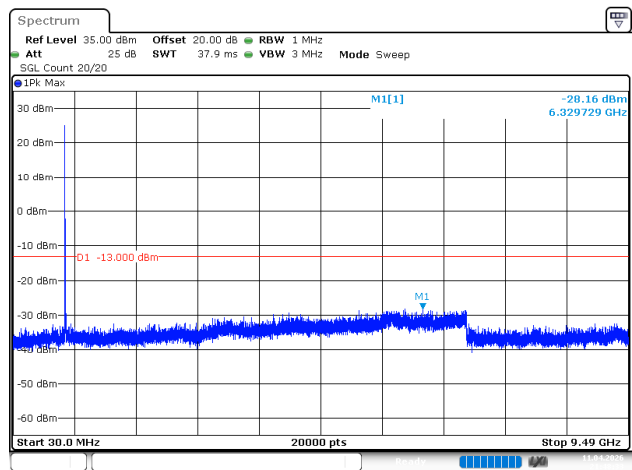


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:48:33

10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

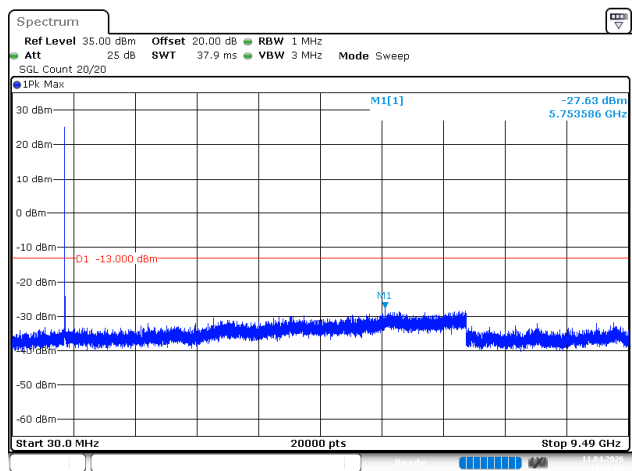

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:48:51

10MHz_High_QPSK_1@0(30MHz~9.49GHz)

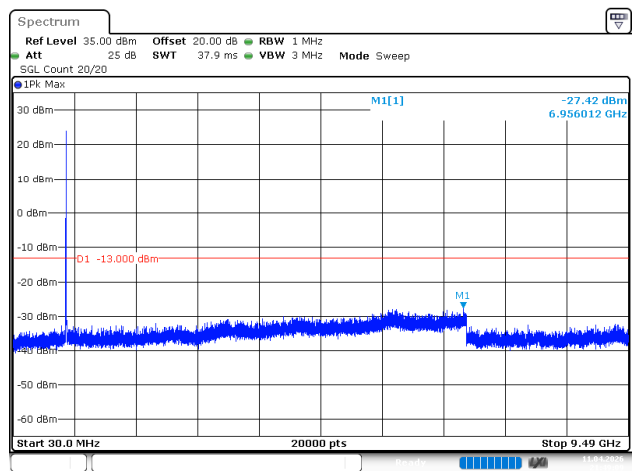


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:49:09


FCC Part 24E

LTE Band 2, Normal
1RB was the worst case


1.4MHz_Low_QPSK_1@0(30MHz~20.1GHz)

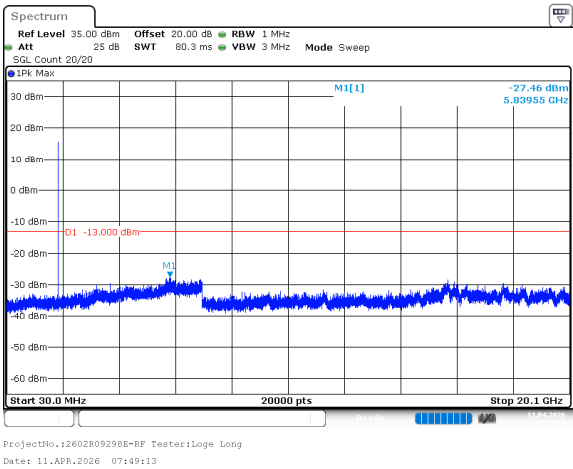


1.4MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

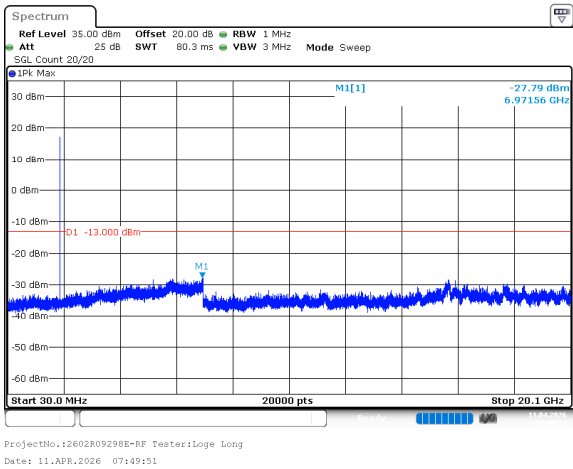


1.4MHz_High_QPSK_1@0(30MHz~20.1GHz)

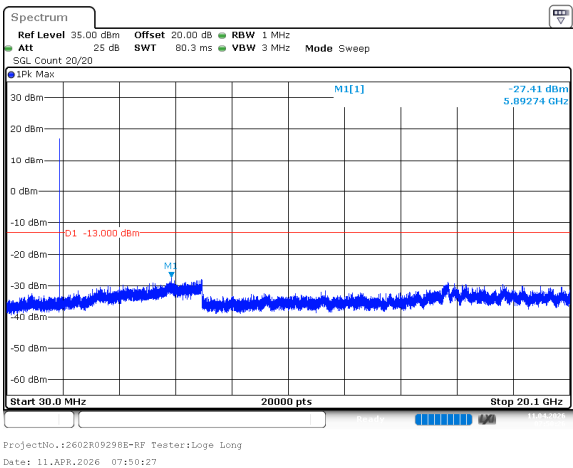


3MHz_Low_QPSK_1@0(30MHz~20.1GHz)

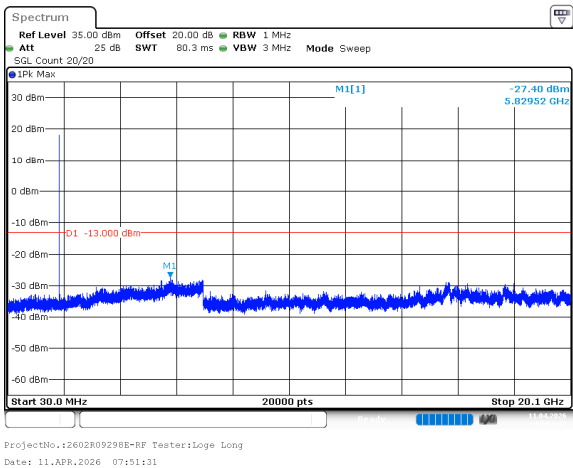


3MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

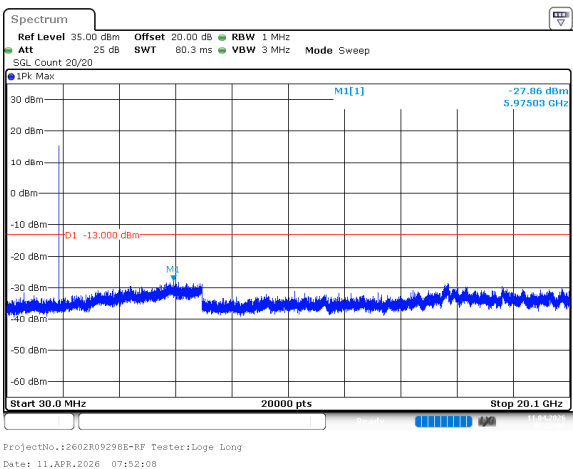

3MHz_High_QPSK_1@0(30MHz~20.1GHz)

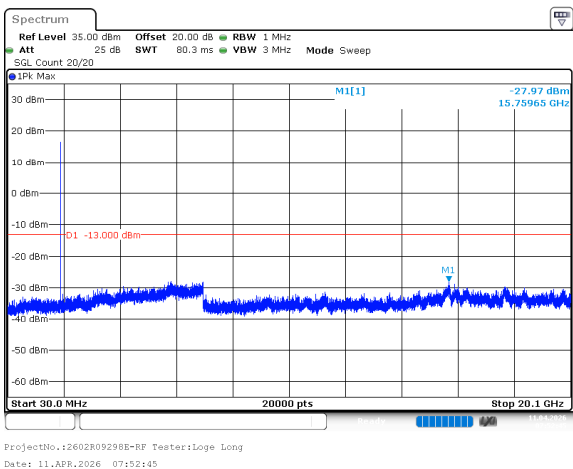


5MHz_Low_QPSK_1@0(30MHz~20.1GHz)

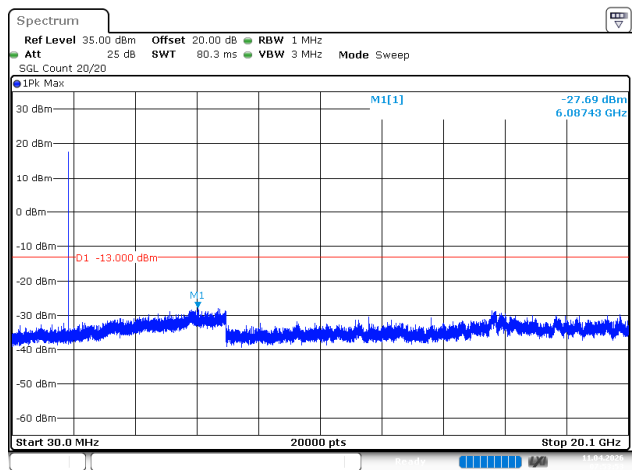


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 07:53:52

5MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

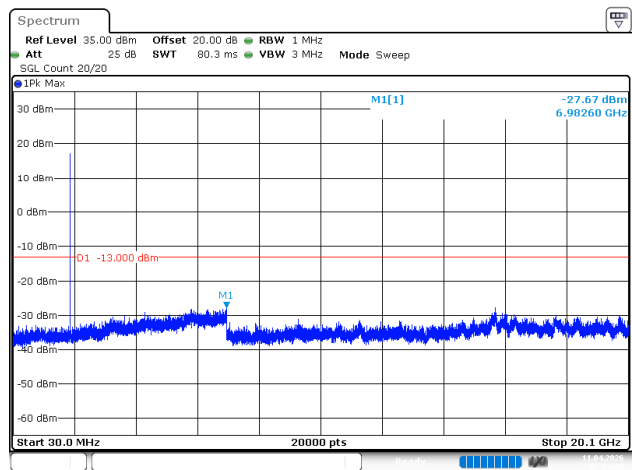


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 07:54:30

5MHz_High_QPSK_1@0(30MHz~20.1GHz)

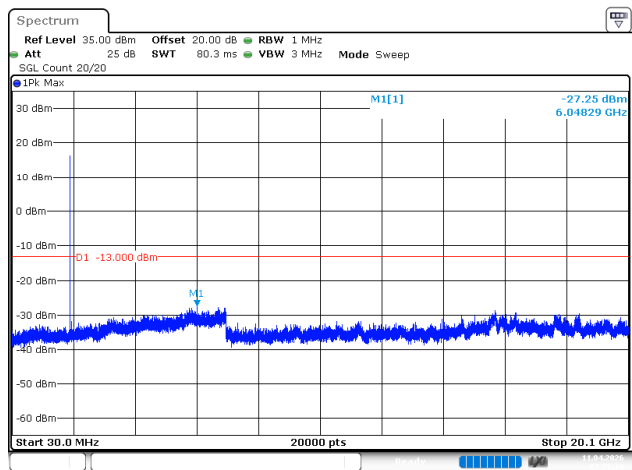


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 07:55:09

10MHz_Low_QPSK_1@0(30MHz~20.1GHz)

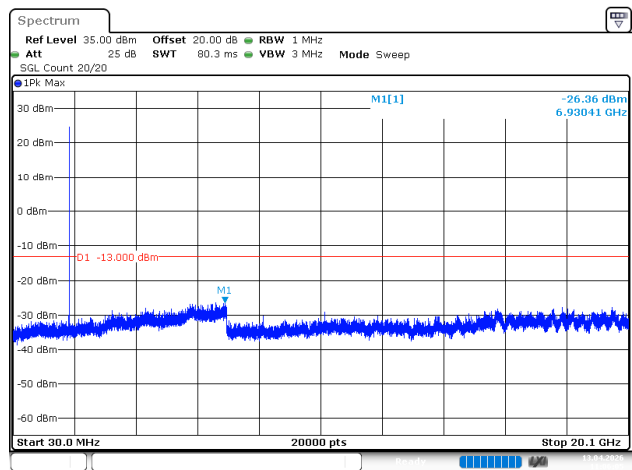


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:06:05

10MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

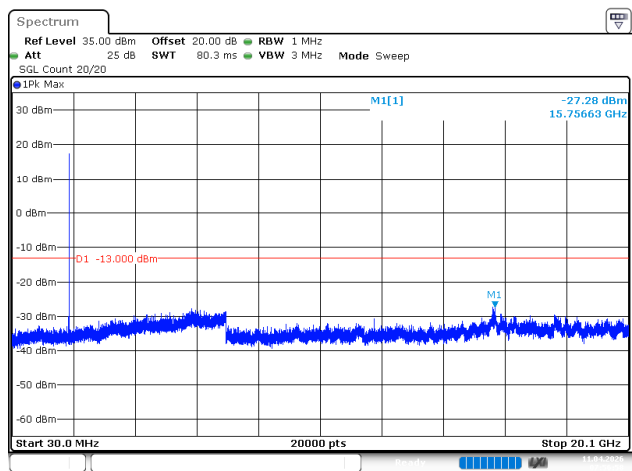


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 07:56:58

10MHz_High_QPSK_1@0(30MHz~20.1GHz)

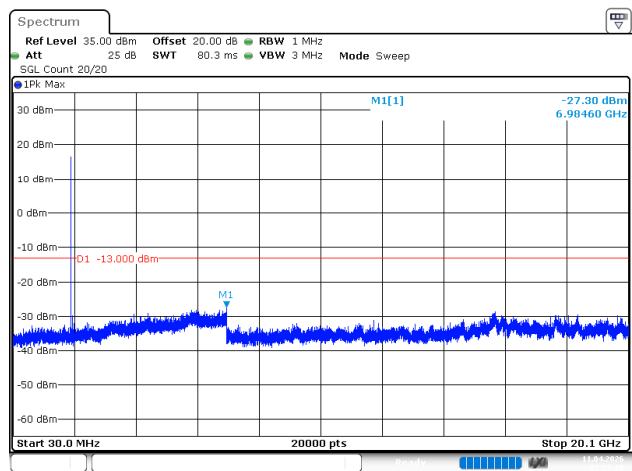


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 07:57:38

15MHz_Low_QPSK_1@0(30MHz~20.1GHz)

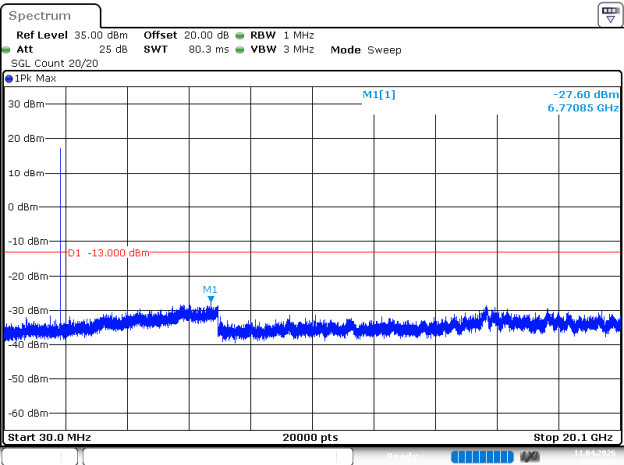


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 07:58:46

15MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

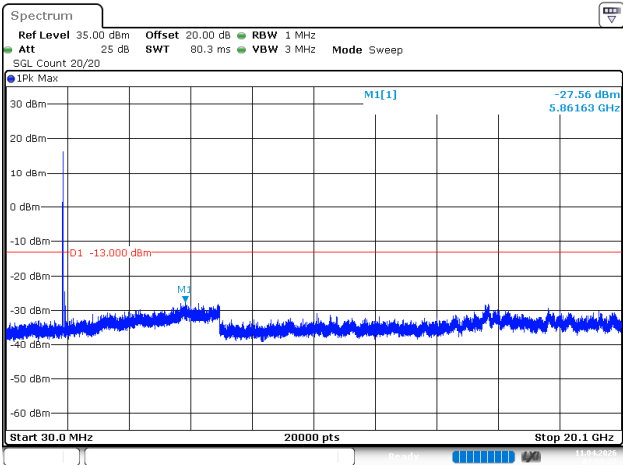


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 07:59:27

15MHz_High_QPSK_1@0(30MHz~20.1GHz)

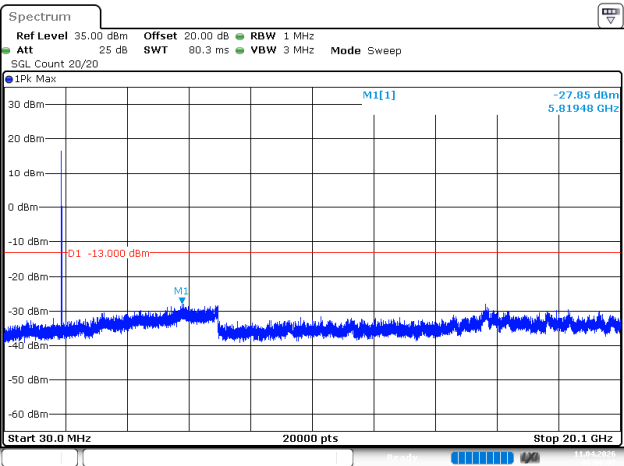


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 08:00:07

20MHz_Low_QPSK_1@0(30MHz~20.1GHz)

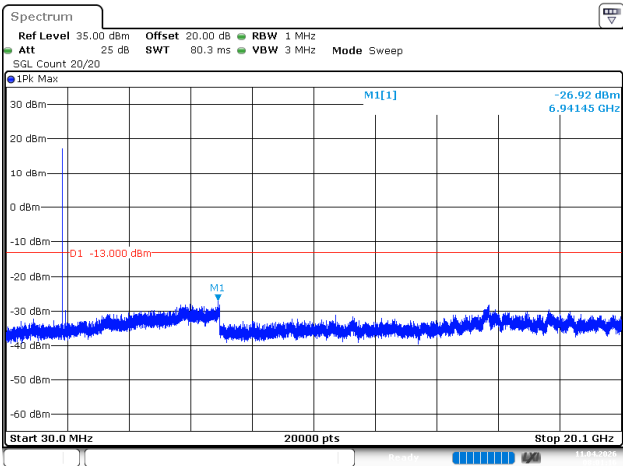


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 08:01:16

20MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

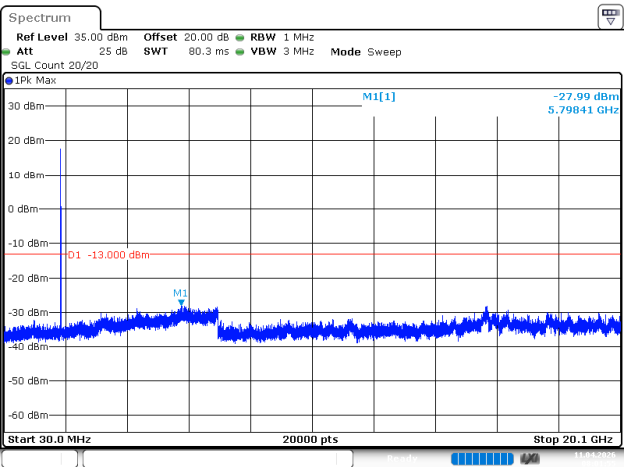

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 08:01:55

20MHz_High_QPSK_1@0(30MHz~20.1GHz)

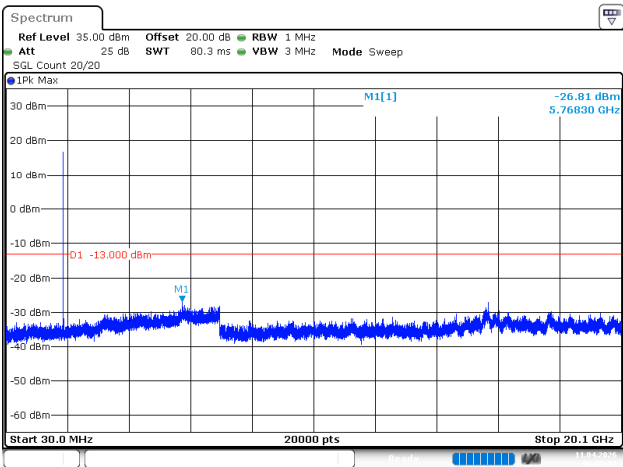


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 08:02:34


FCC Part 27

LTE Band 4, Normal
1RB was the worst case


1.4MHz_Low_QPSK_1@0(30MHz~18.55GHz)

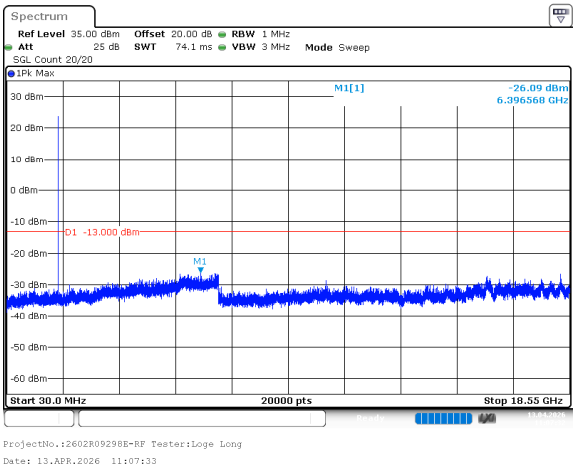


1.4MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

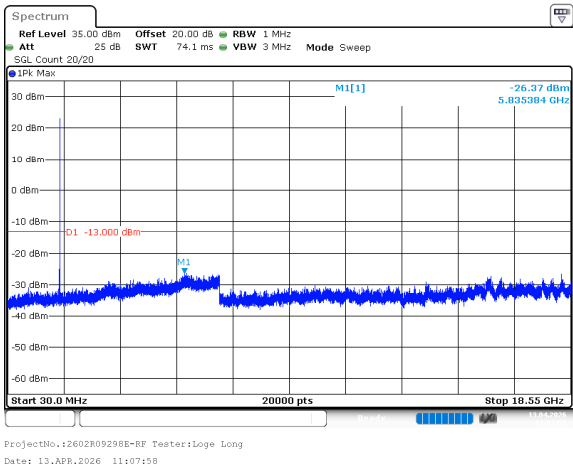


1.4MHz_High_QPSK_1@0(30MHz~18.55GHz)

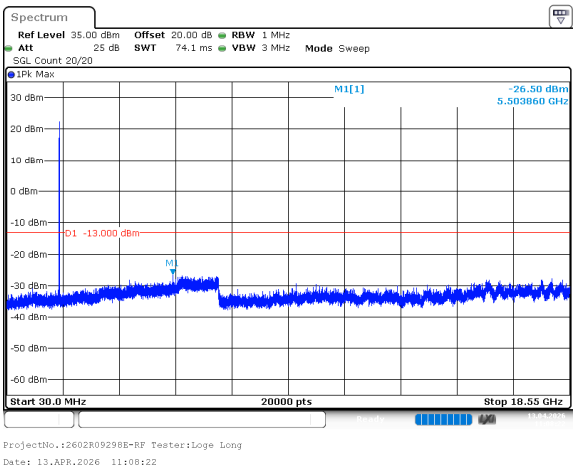


3MHz_Low_QPSK_1@0(30MHz~18.55GHz)

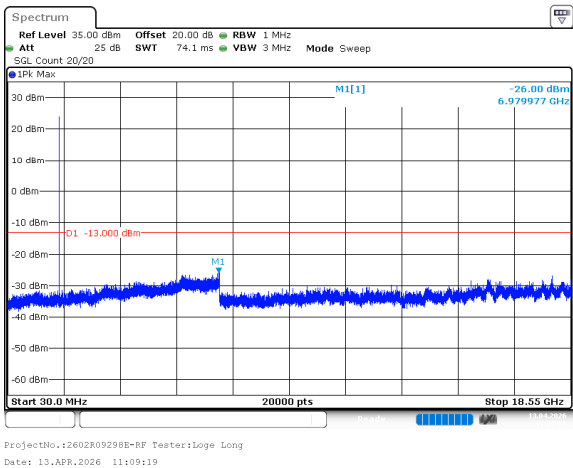


3MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

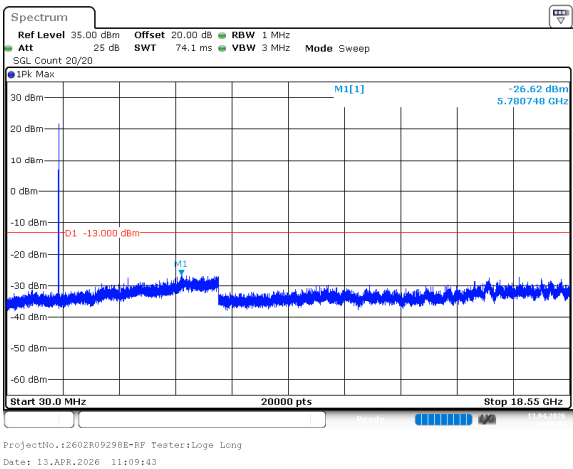

3MHz_High_QPSK_1@0(30MHz~18.55GHz)

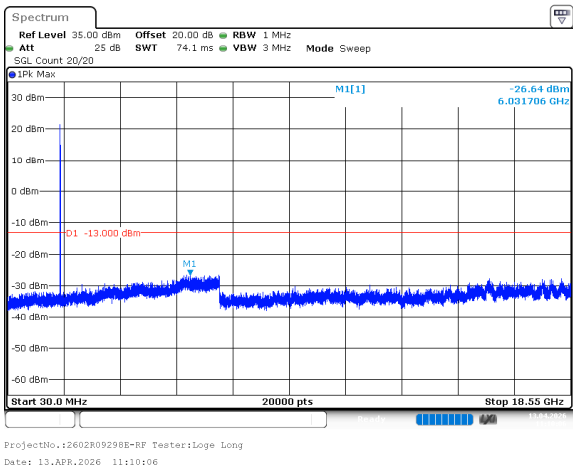


5MHz_Low_QPSK_1@0(30MHz~18.55GHz)

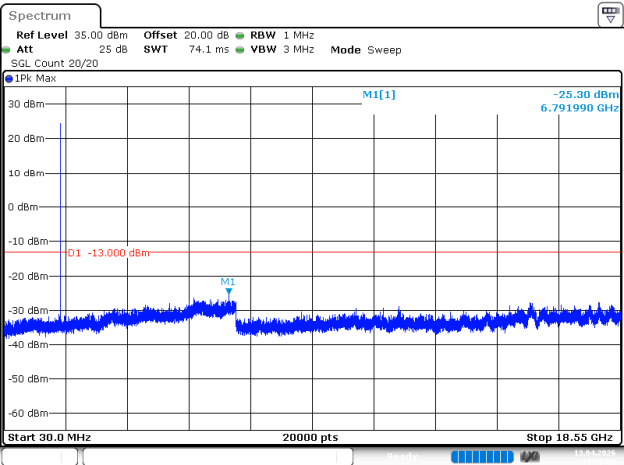


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:11:03

5MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

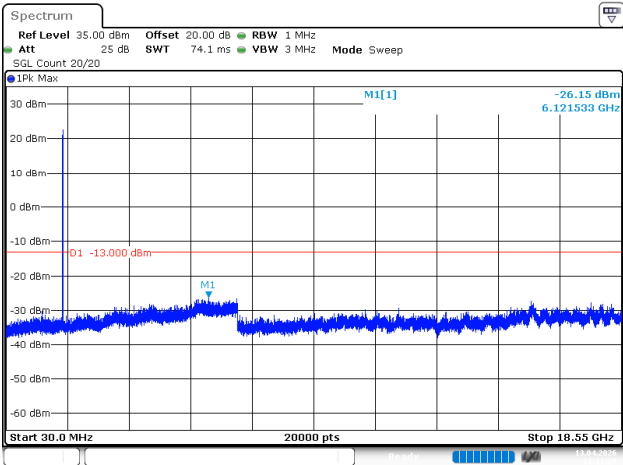


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:11:26

5MHz_High_QPSK_1@0(30MHz~18.55GHz)

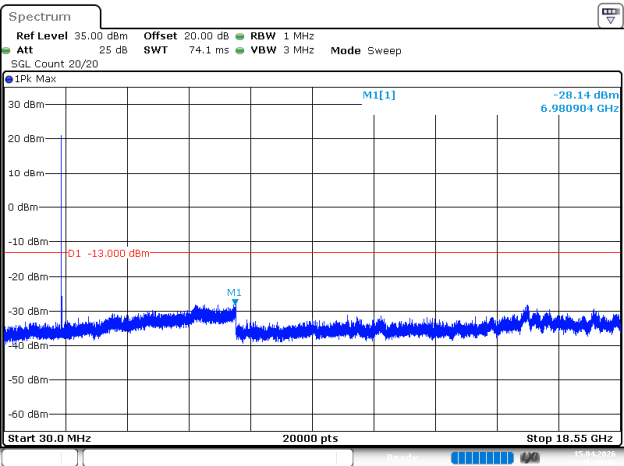


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 15.APR.2026 16:10:47

10MHz_Low_QPSK_1@0(30MHz~18.55GHz)

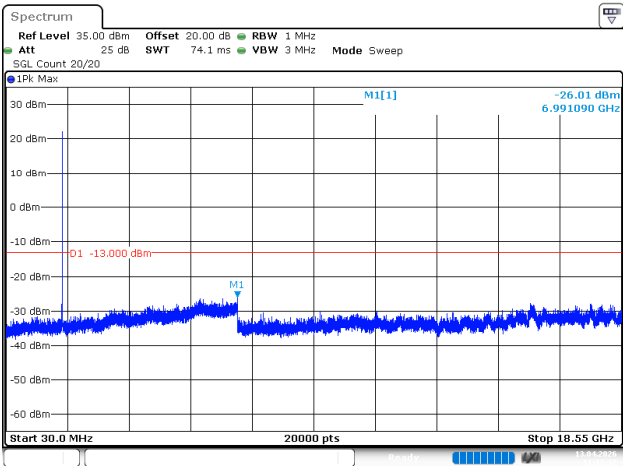


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:12:31

10MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

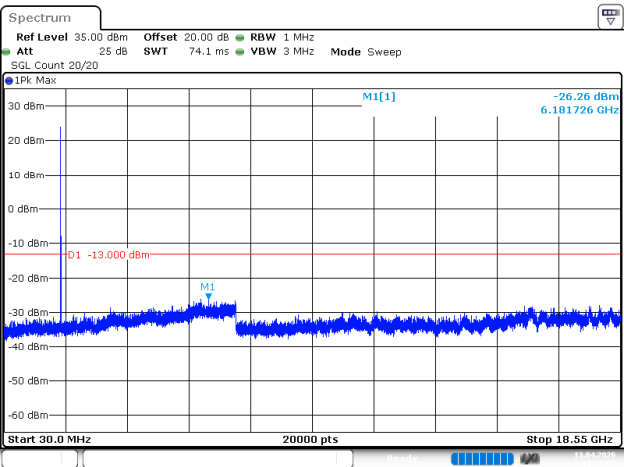


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:12:54

10MHz_High_QPSK_1@0(30MHz~18.55GHz)

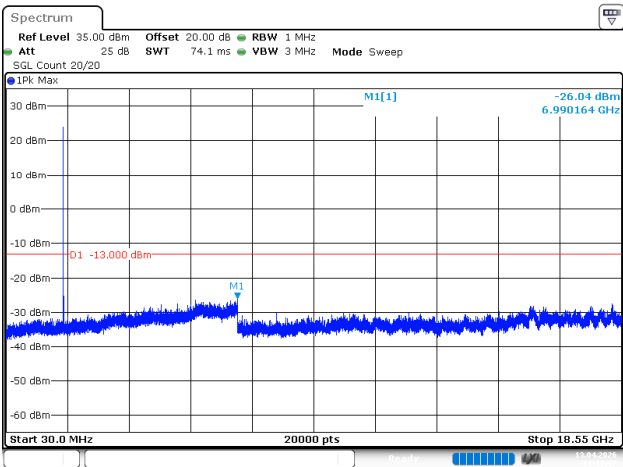


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:13:17

15MHz_Low_QPSK_1@0(30MHz~18.55GHz)

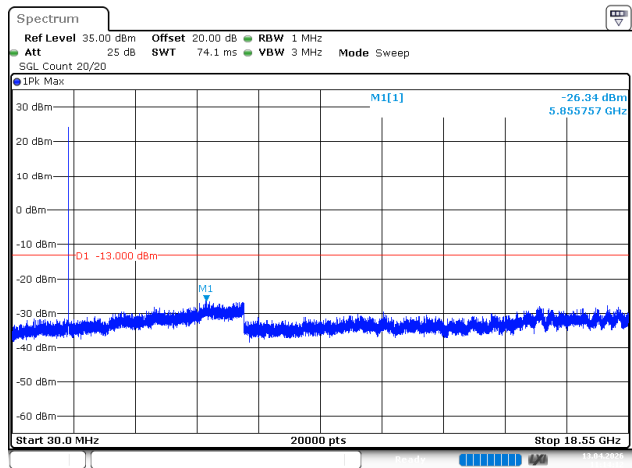


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:14:12

15MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

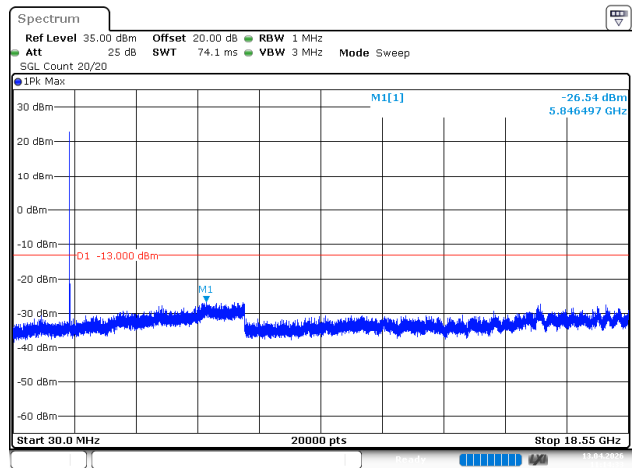


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:14:34

15MHz_High_QPSK_1@0(30MHz~18.55GHz)

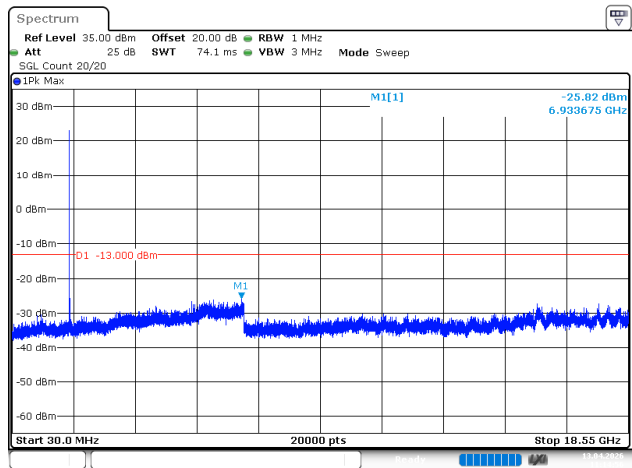


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:14:57

20MHz_Low_QPSK_1@0(30MHz~18.55GHz)

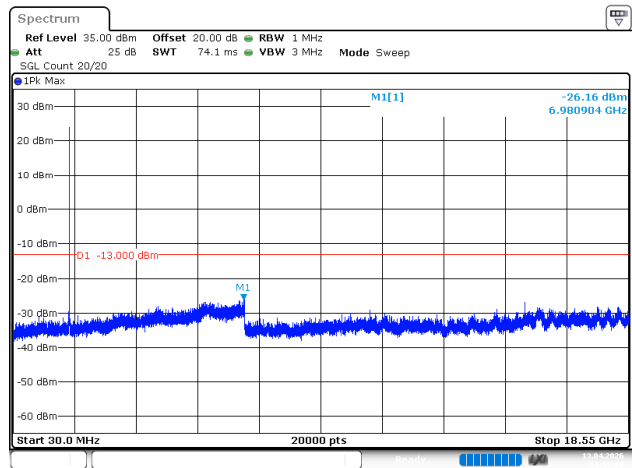


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:16:00

20MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

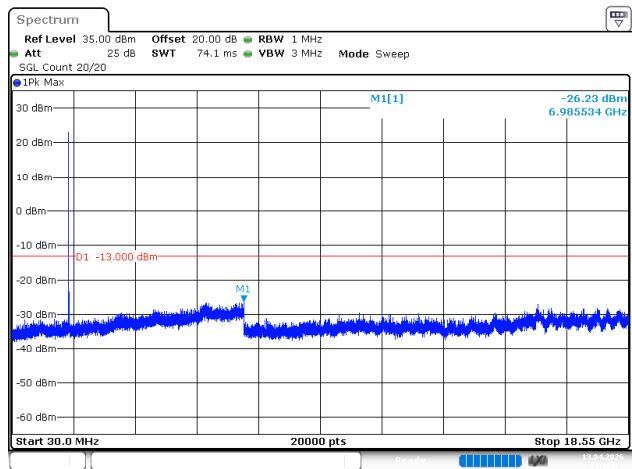

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:16:22

20MHz_High_QPSK_1@0(30MHz~18.55GHz)

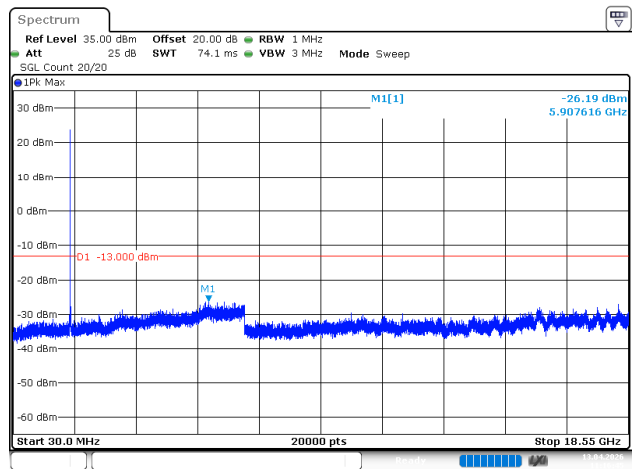


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 11:16:45


LTE Band 7, Normal

1RB was the worst case


5MHz_Low_QPSK_1@0(30MHz~26.7GHz)

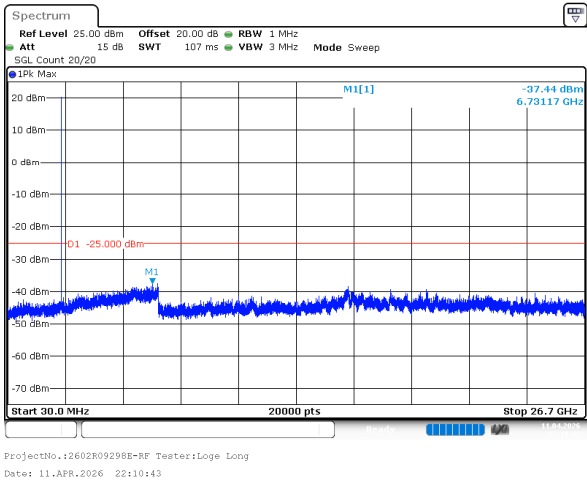


5MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

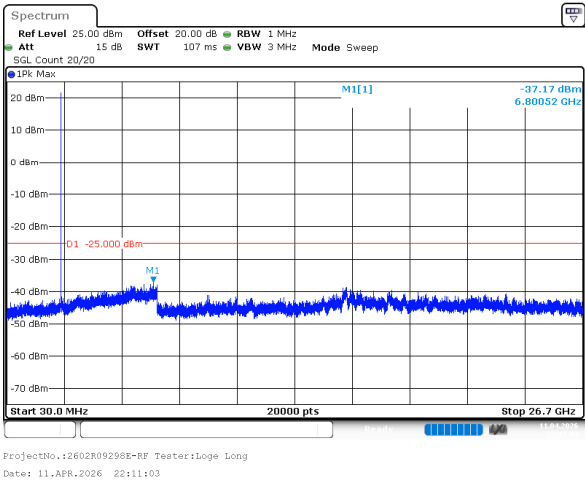


5MHz_High_QPSK_1@0(30MHz~26.7GHz)

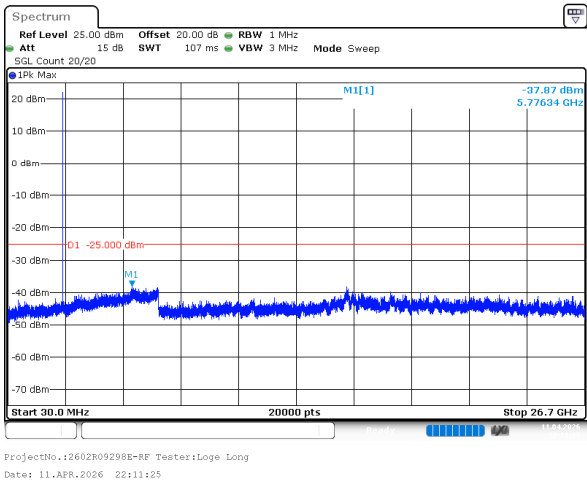


10MHz_Low_QPSK_1@0(30MHz~26.7GHz)

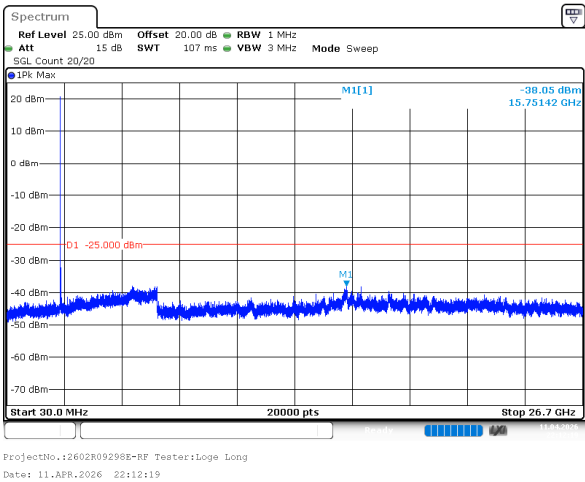


10MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

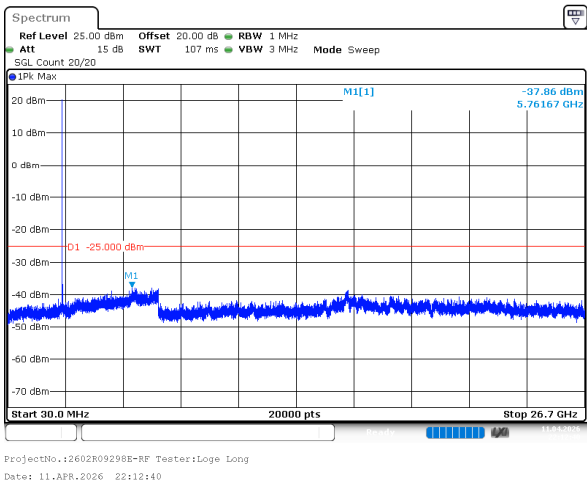

10MHz_High_QPSK_1@0(30MHz~26.7GHz)

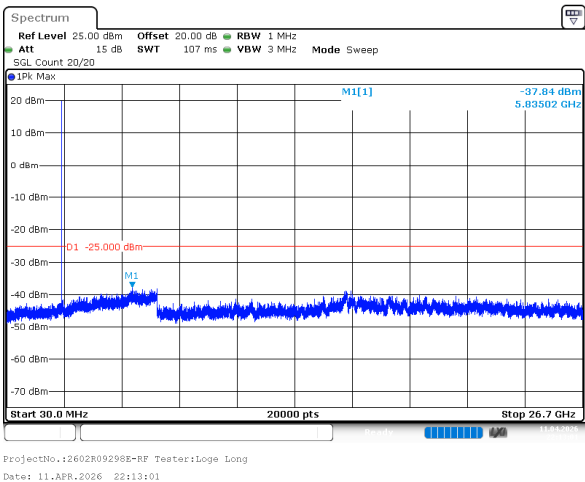


15MHz_Low_QPSK_1@0(30MHz~26.7GHz)

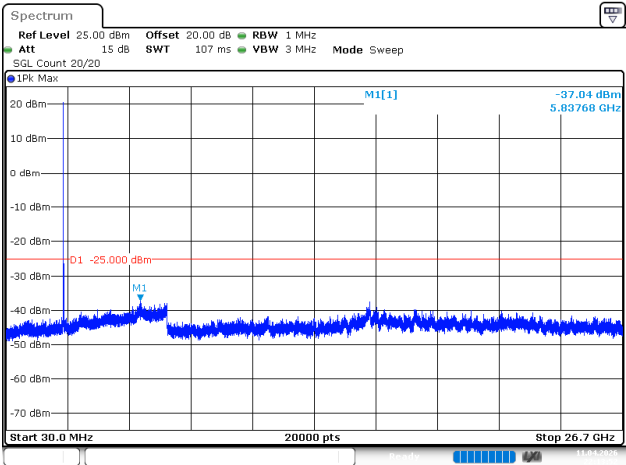


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:13:53

15MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

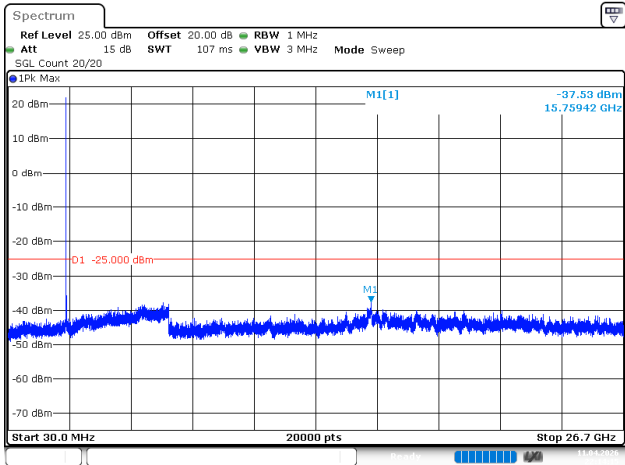


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:14:15

15MHz_High_QPSK_1@0(30MHz~26.7GHz)

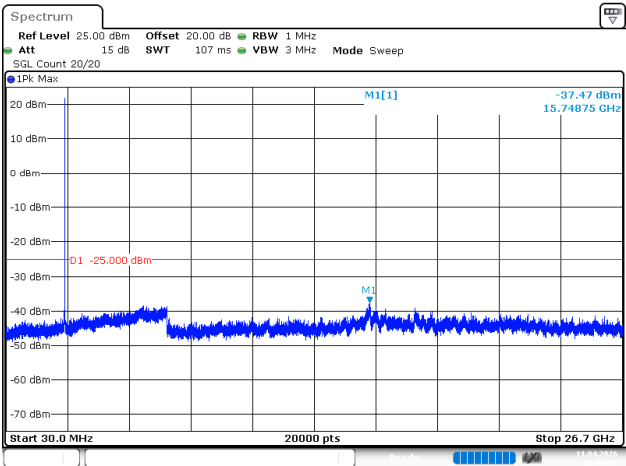


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:14:37

20MHz_Low_QPSK_1@0(30MHz~26.7GHz)

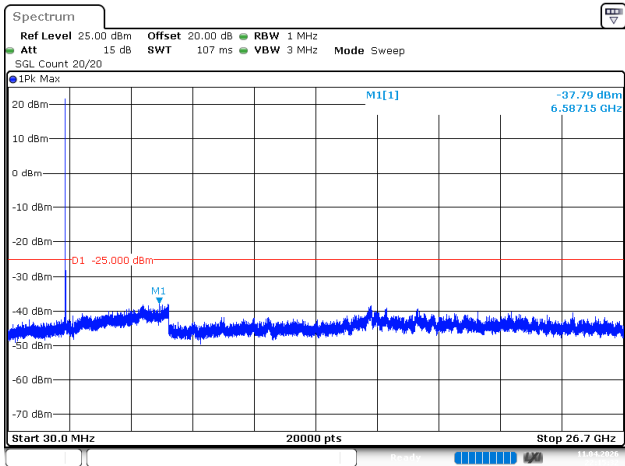


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:15:32

20MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

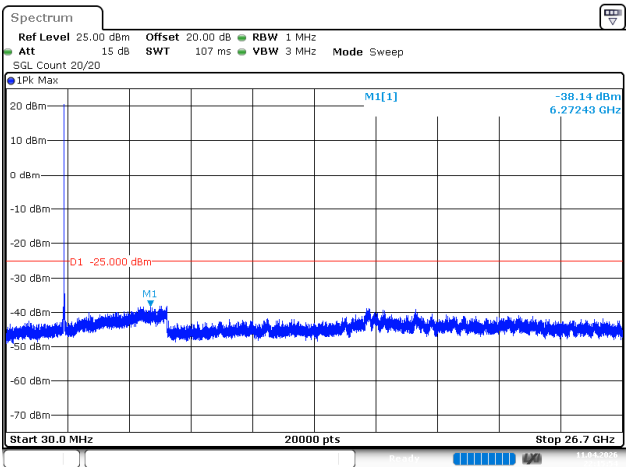

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:15:54

20MHz_High_QPSK_1@0(30MHz~26.7GHz)

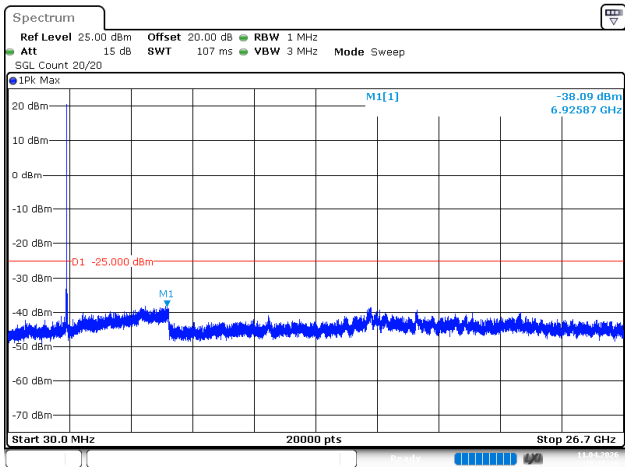


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:16:16


LTE Band 12, Normal

1RB was the worst case


1.4MHz_Low_QPSK_1@0(30MHz~8.16GHz)

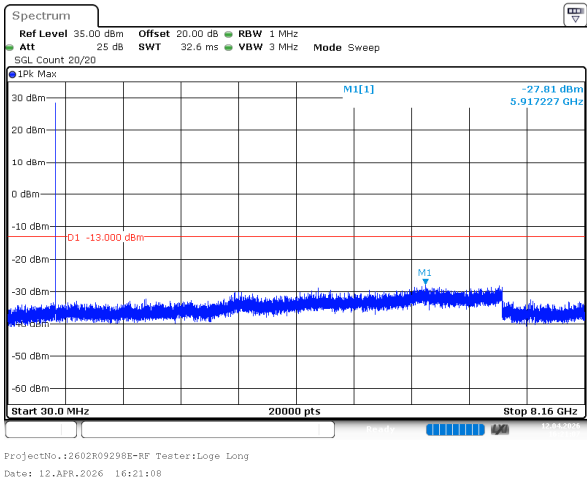


1.4MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

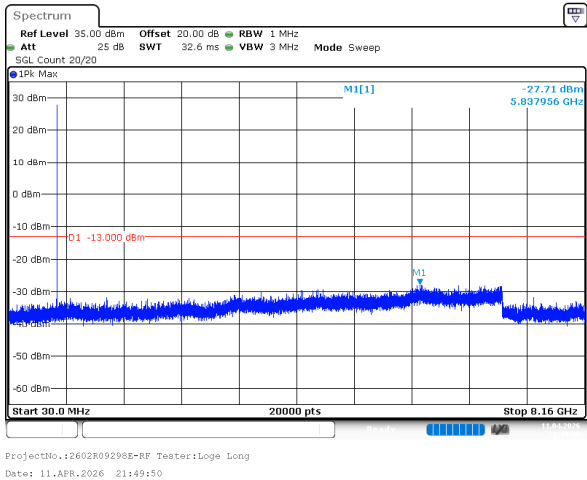


1.4MHz_High_QPSK_1@0(30MHz~8.16GHz)

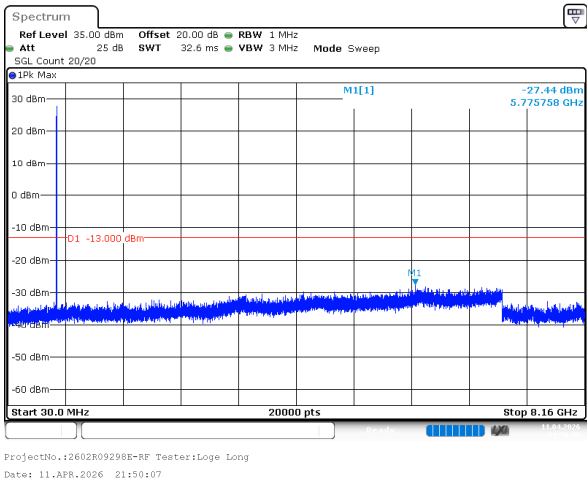


3MHz_Low_QPSK_1@0(30MHz~8.16GHz)

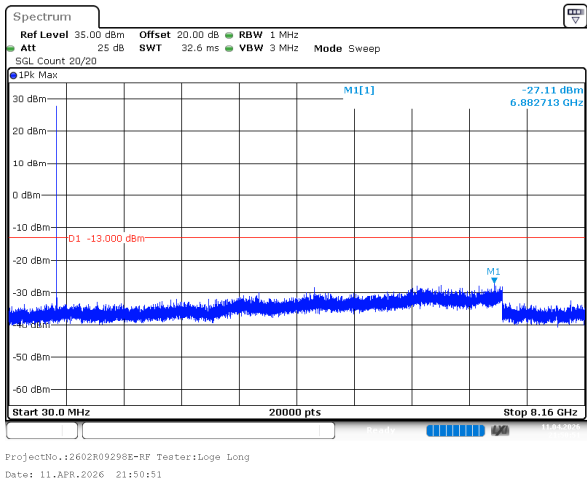


3MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

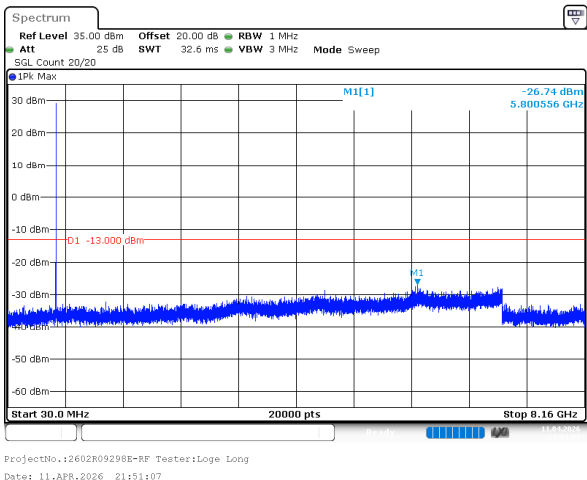

3MHz_High_QPSK_1@0(30MHz~8.16GHz)

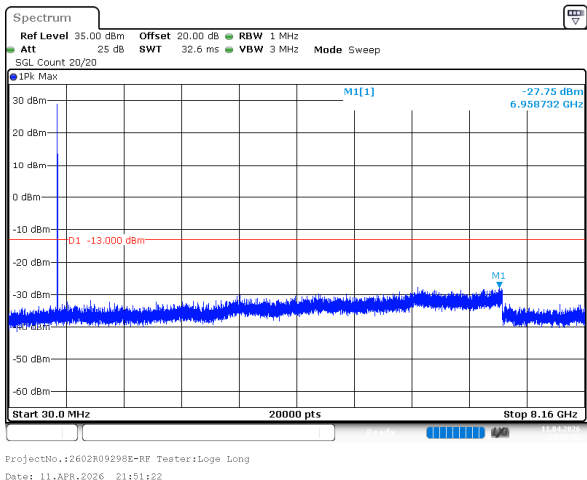


5MHz_Low_QPSK_1@0(30MHz~8.16GHz)

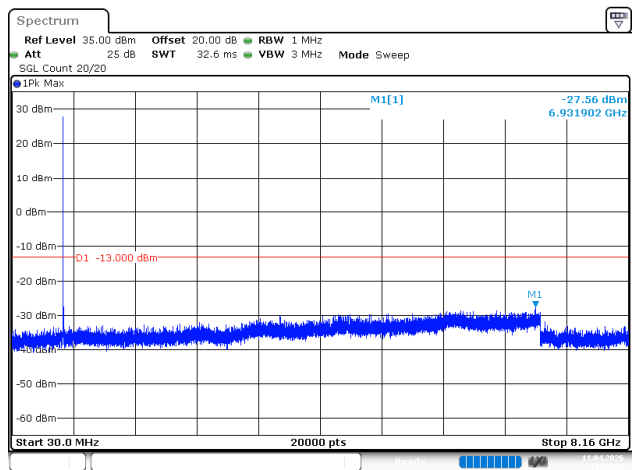


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:52:05

5MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

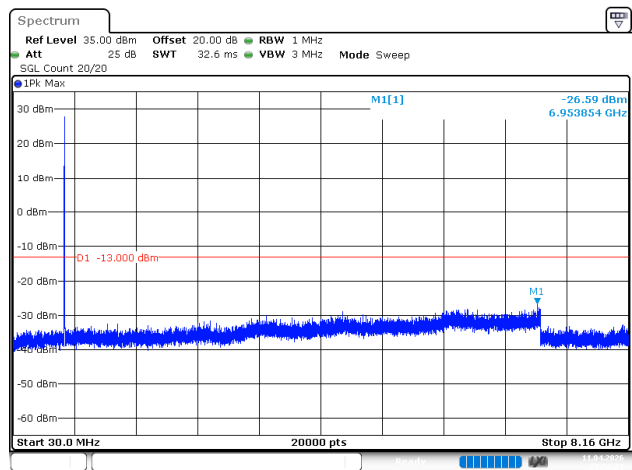


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:52:21

5MHz_High_QPSK_1@0(30MHz~8.16GHz)

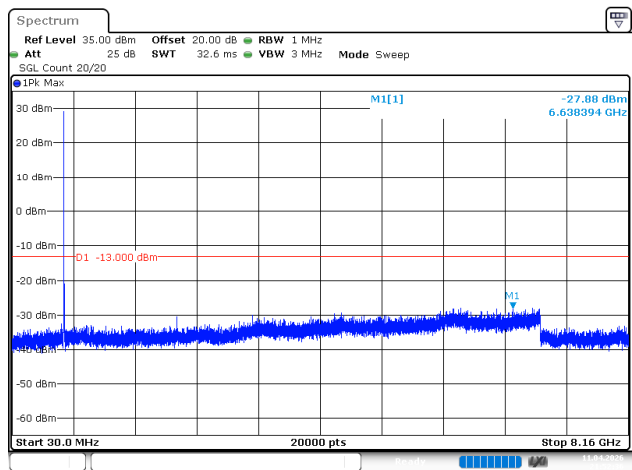


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:52:36

10MHz_Low_QPSK_1@0(30MHz~8.16GHz)

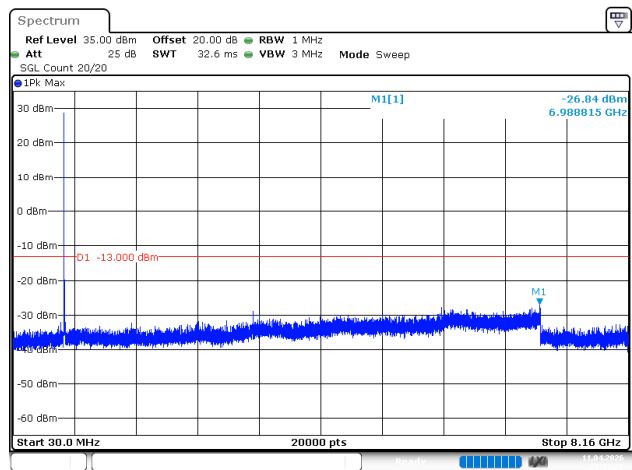


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:53:20

10MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

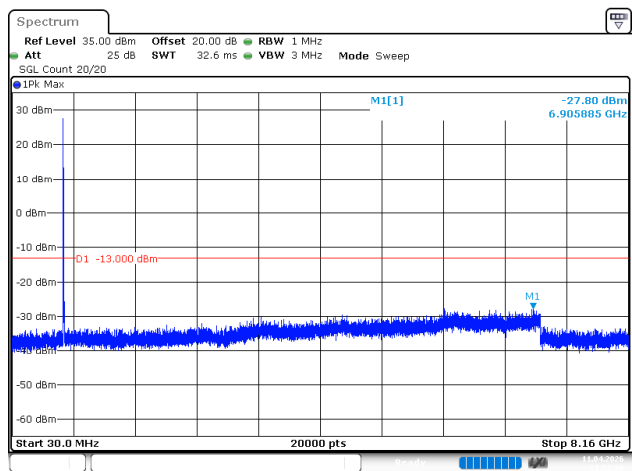

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:53:36

10MHz_High_QPSK_1@0(30MHz~8.16GHz)

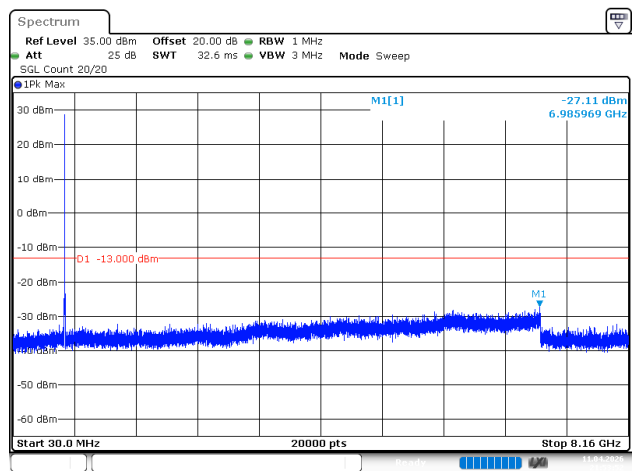


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:53:52


LTE Band 13, Normal

1RB was the worst case


5MHz_Low_QPSK_1@0(30MHz~8.87GHz)

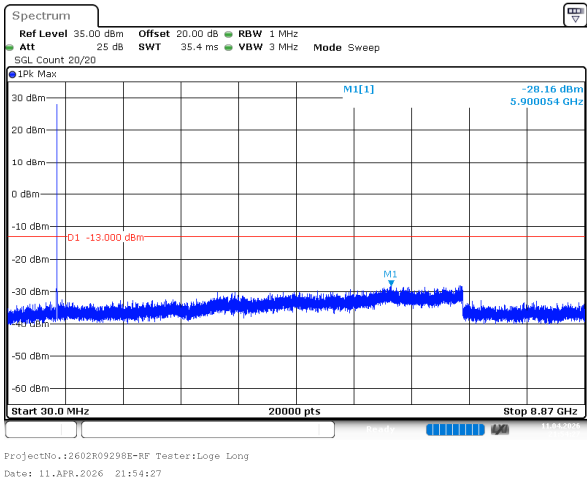


5MHz_Low_QPSK_1@0(763MHz~775MHz)

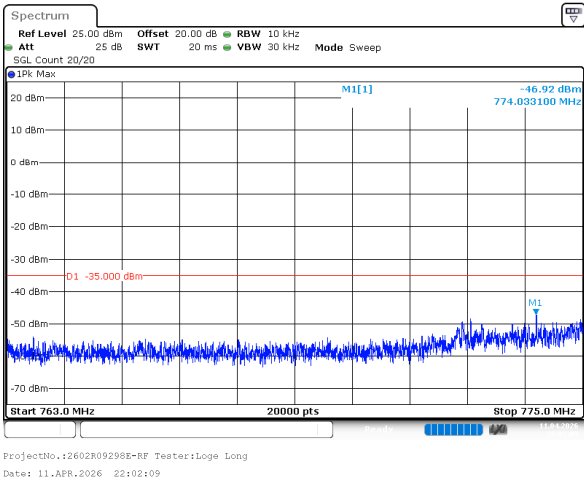


5MHz_Low_QPSK_1@0(793MHz~806MHz)

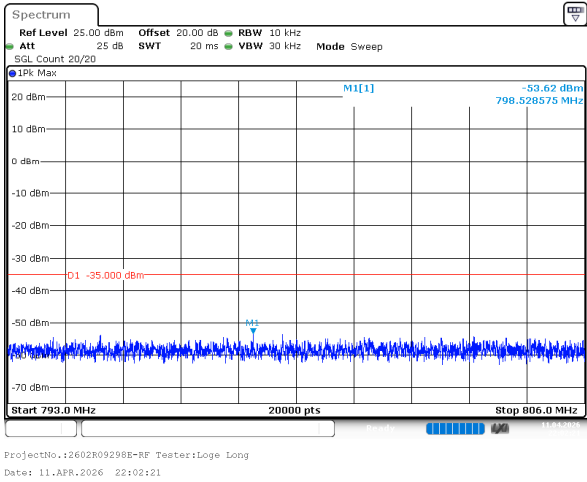


5MHz_Low_QPSK_1@0(1559MHz~1610MHz)

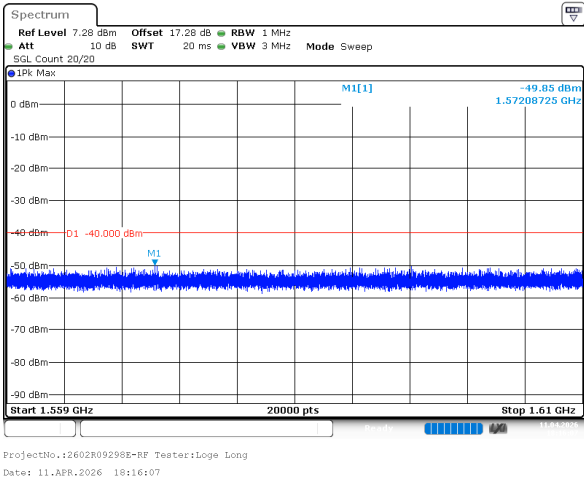


5MHz_High_QPSK_1@0(30MHz~8.87GHz)

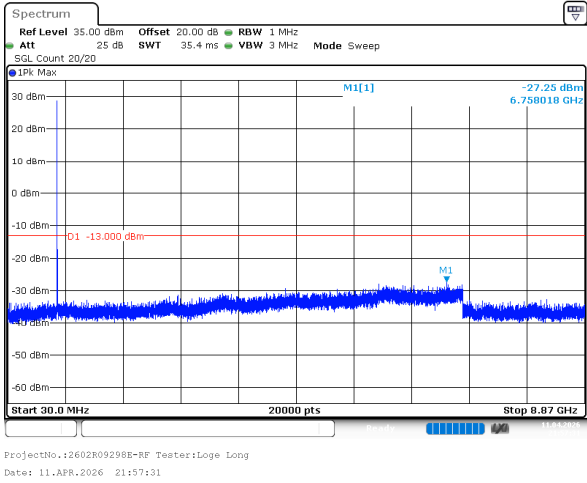

5MHz_High_QPSK_1@0(763MHz~775MHz)

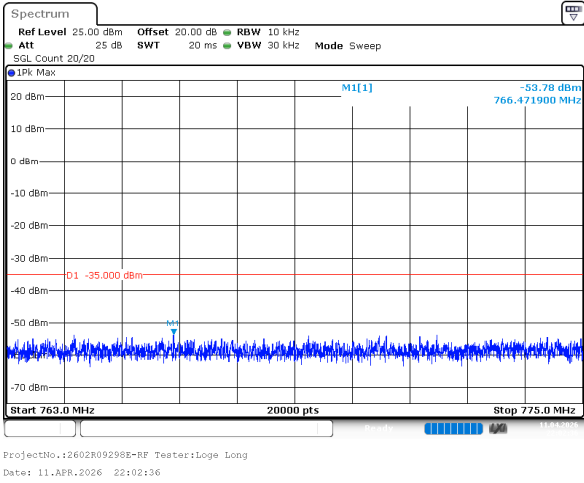


5MHz_High_QPSK_1@0(793MHz~806MHz)

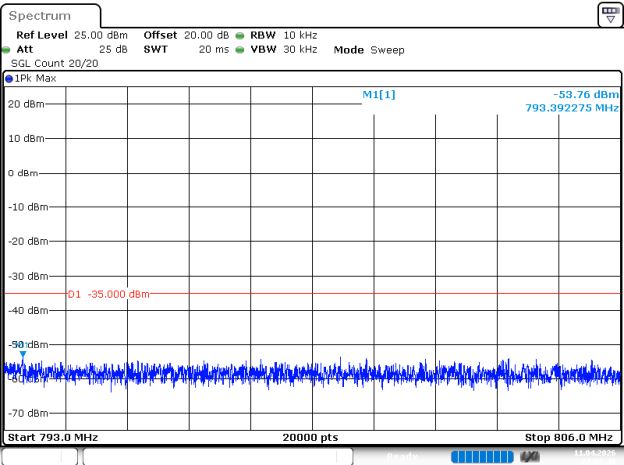


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:02:48

5MHz_High_QPSK_1@0(1559MHz~1610MHz)

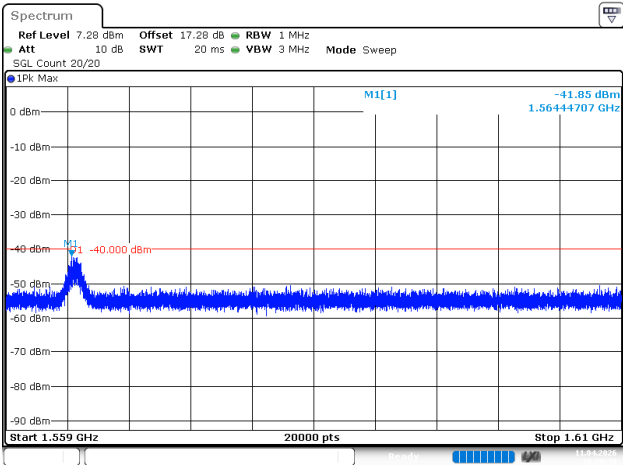


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 18:20:39

10MHz_Middle_QPSK_1@0(30MHz~8.87GHz)

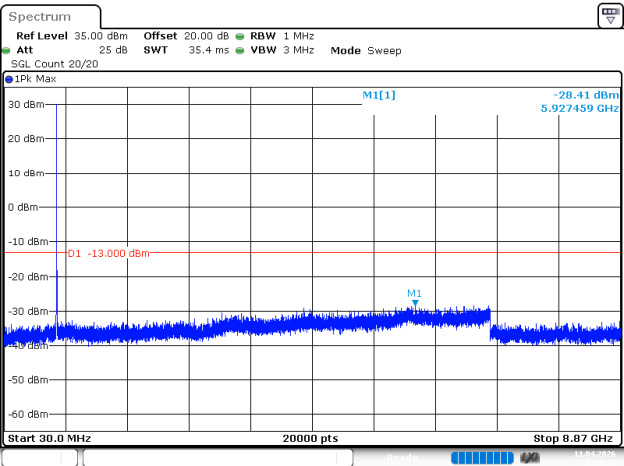


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 21:58:37

10MHz_Middle_QPSK_1@0(763MHz~775MHz)

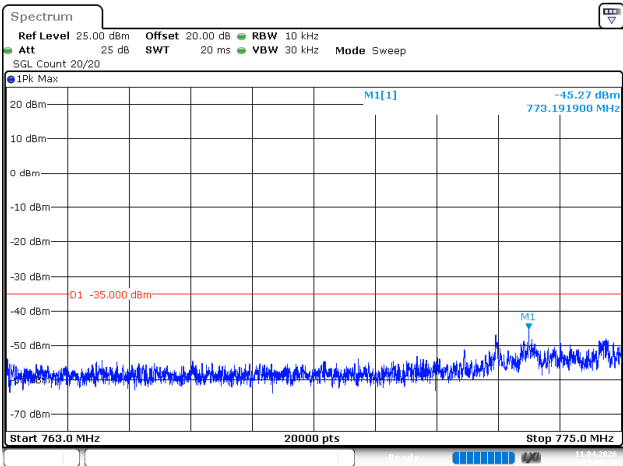


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:03:33

10MHz_Middle_QPSK_1@0(793MHz~806MHz)

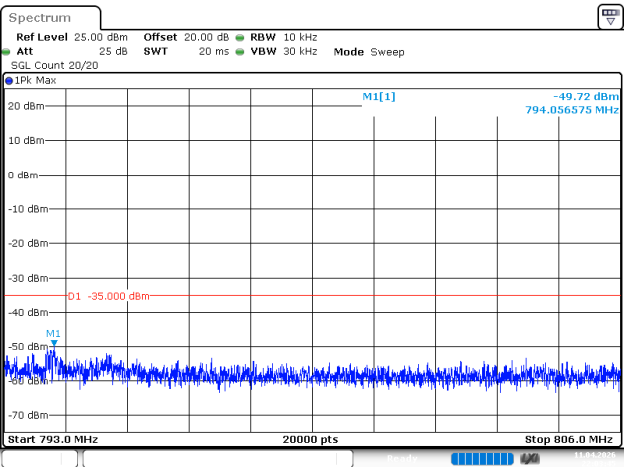

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:03:45

10MHz_Middle_QPSK_1@0(1559MHz~1610MHz)

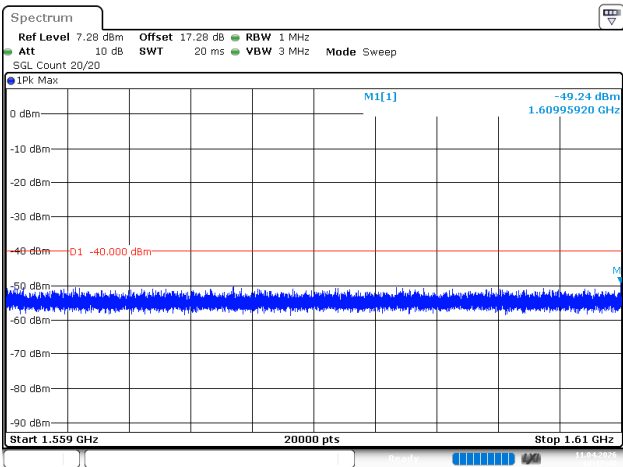


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 18:17:46


LTE Band 17, Normal

1RB was the worst case


5MHz_Low_QPSK_1@0(30MHz~8.16GHz)

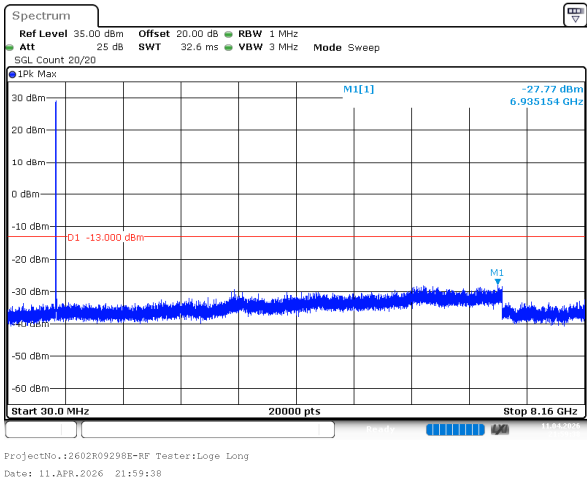


5MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

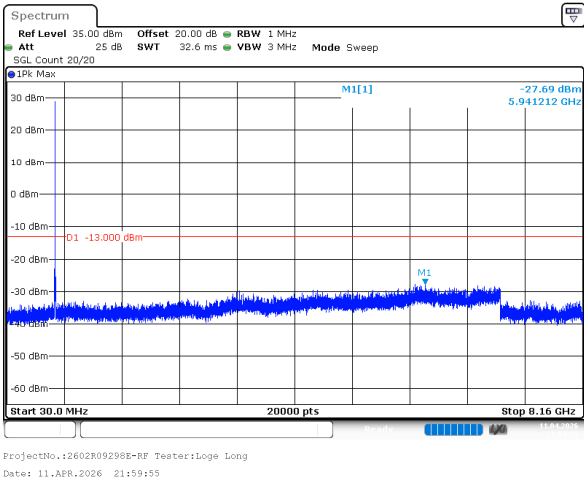


5MHz_High_QPSK_1@0(30MHz~8.16GHz)

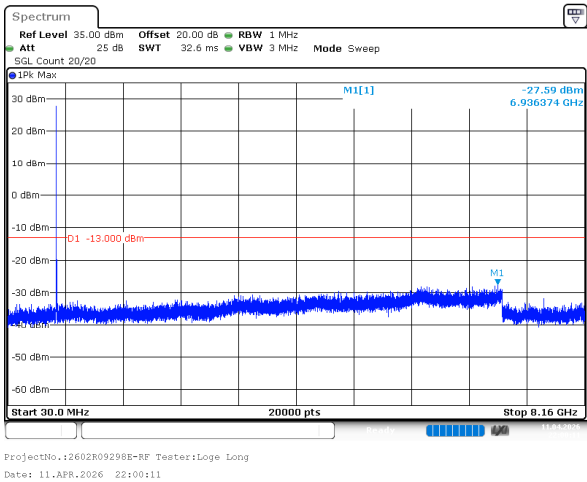


10MHz_Low_QPSK_1@0(30MHz~8.16GHz)

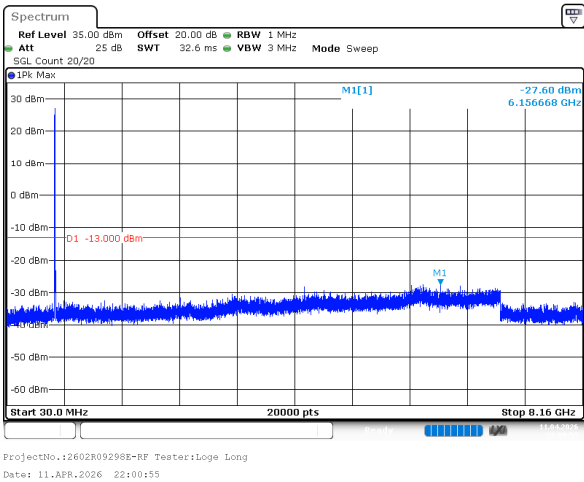

10MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

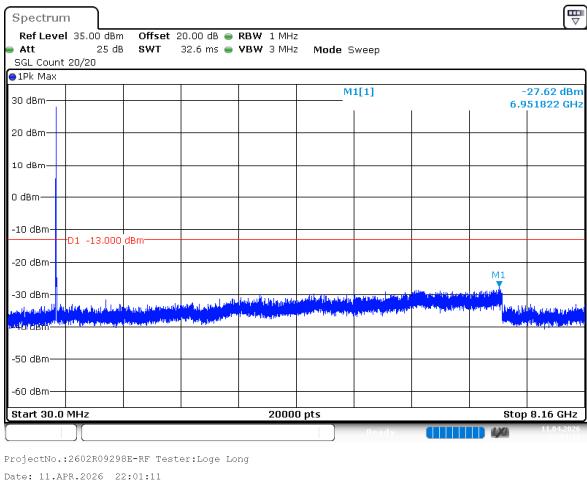


10MHz_High_QPSK_1@0(30MHz~8.16GHz)

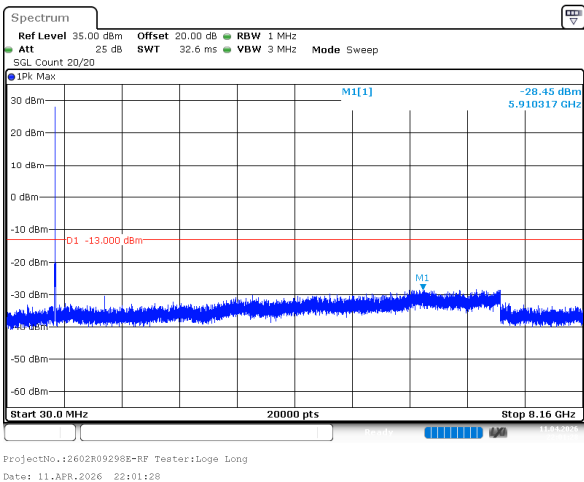


LTE Band 38, Normal

1RB was the worst case


5MHz_Low_QPSK_1@0(30MHz~27.2GHz)

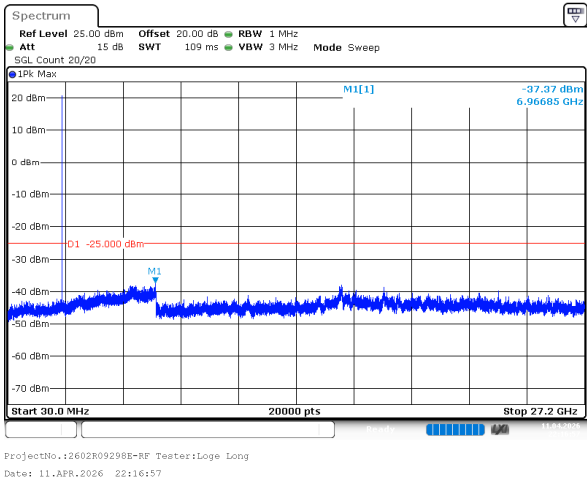


5MHz_Middle_QPSK_1@0(30MHz~27.2GHz)

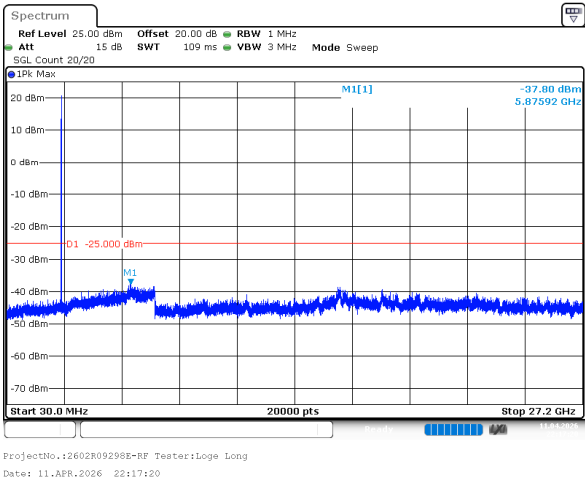


5MHz_High_QPSK_1@0(30MHz~27.2GHz)

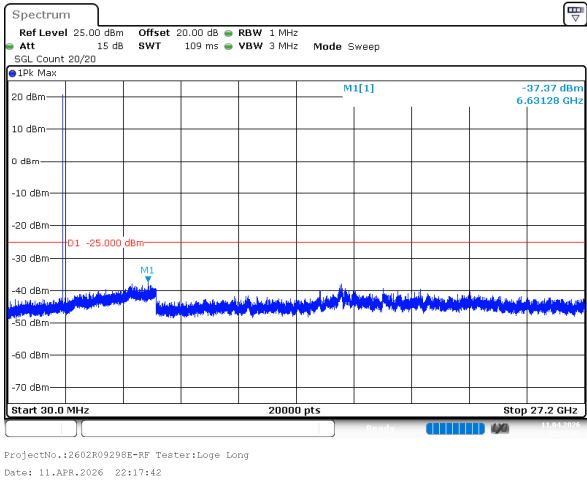


10MHz_Low_QPSK_1@0(30MHz~27.2GHz)

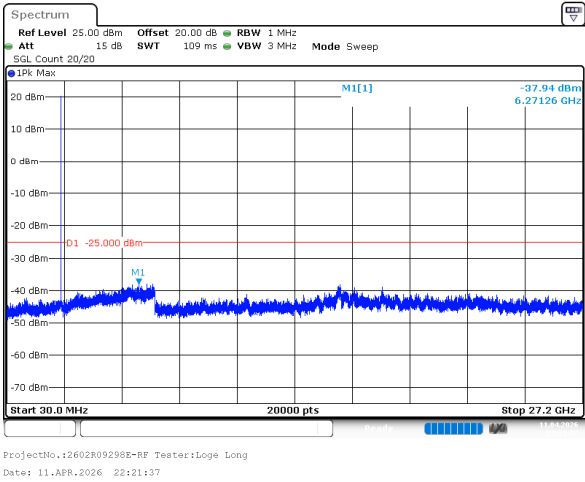


10MHz_Middle_QPSK_1@0(30MHz~27.2GHz)

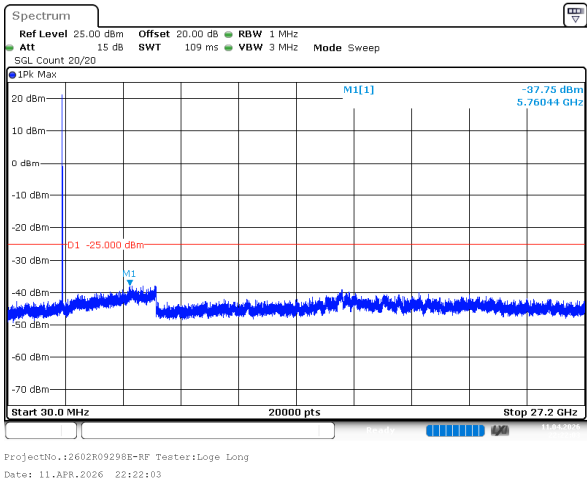

10MHz_High_QPSK_1@0(30MHz~27.2GHz)

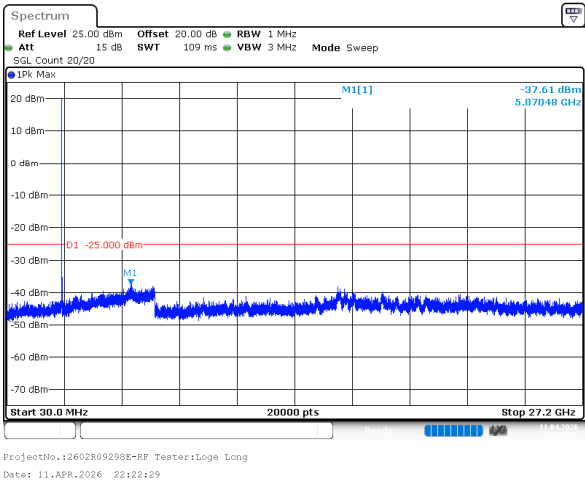


15MHz_Low_QPSK_1@0(30MHz~27.2GHz)

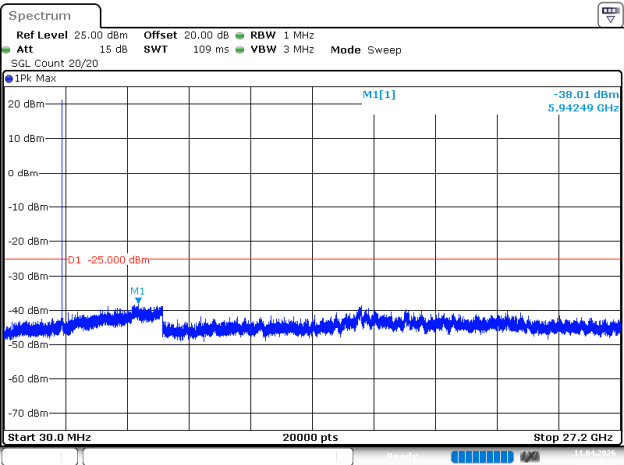


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:29:46

15MHz_Middle_QPSK_1@0(30MHz~27.2GHz)

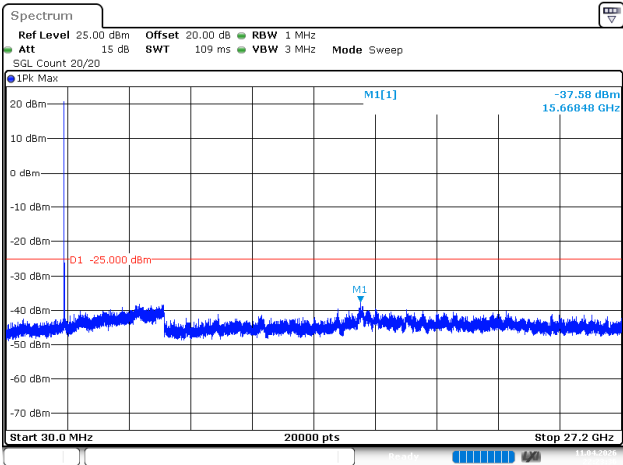


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:23:36

15MHz_High_QPSK_1@0(30MHz~27.2GHz)

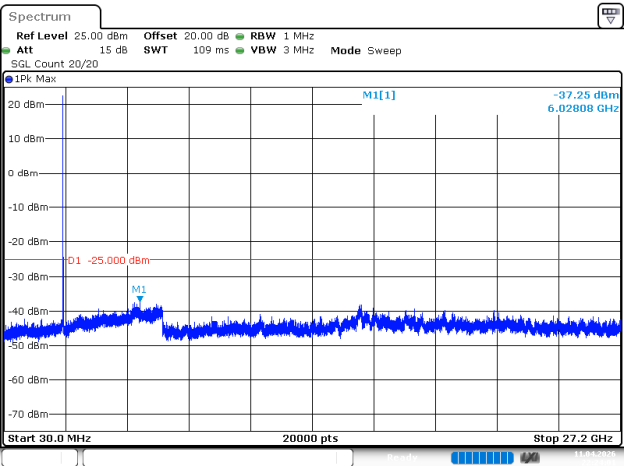


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:24:02

20MHz_Low_QPSK_1@0(30MHz~27.2GHz)

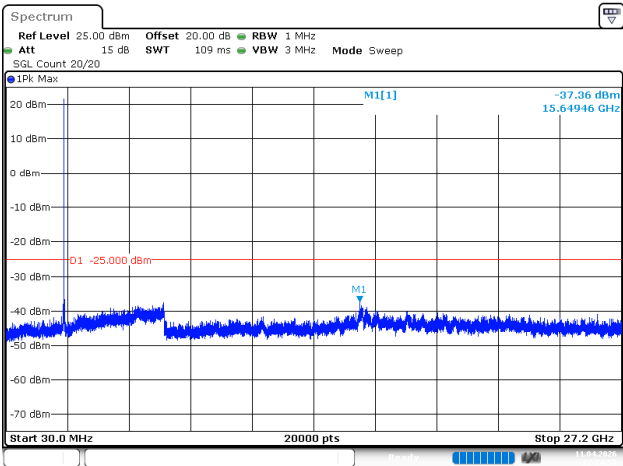


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:24:55

20MHz_Middle_QPSK_1@0(30MHz~27.2GHz)

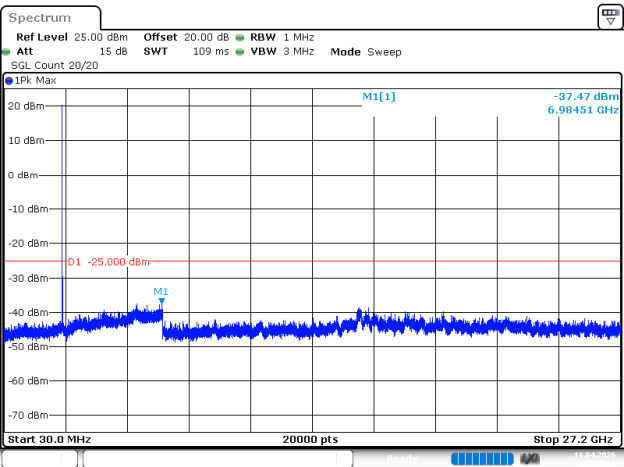

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:25:20

20MHz_High_QPSK_1@0(30MHz~27.2GHz)

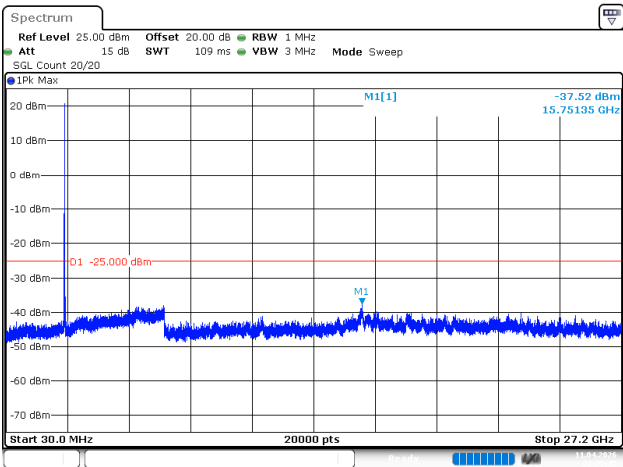


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:25:45


LTE Band 41, Normal

1RB was the worst case


5MHz_Low_QPSK_1@0(30MHz~27.9GHz)

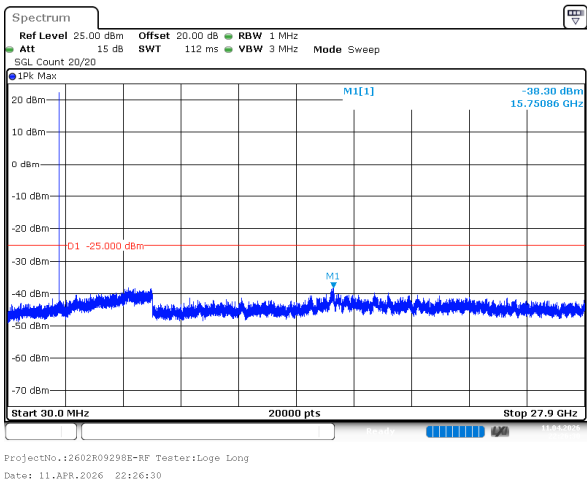


5MHz_Middle_QPSK_1@0(30MHz~27.9GHz)

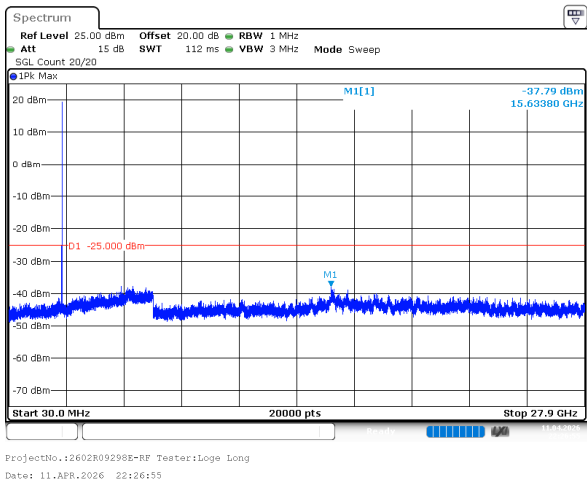


5MHz_High_QPSK_1@0(30MHz~27.9GHz)

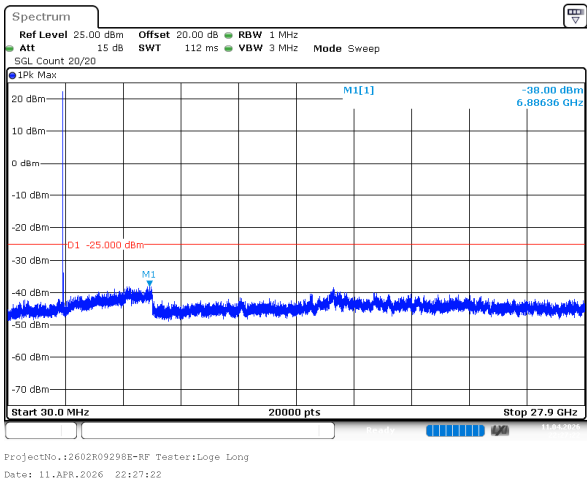


10MHz_Low_QPSK_1@0(30MHz~27.9GHz)

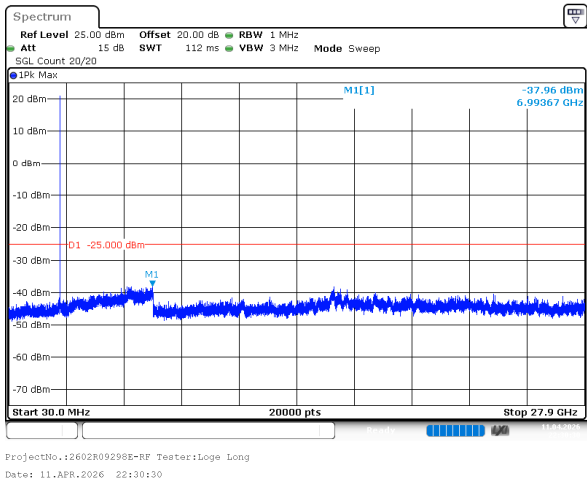


10MHz_Middle_QPSK_1@0(30MHz~27.9GHz)

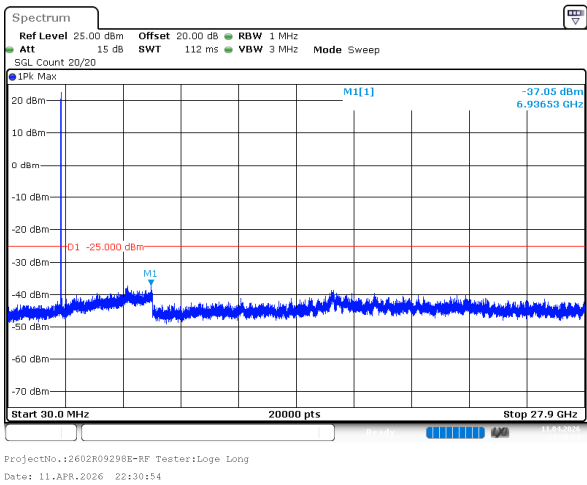

10MHz_High_QPSK_1@0(30MHz~27.9GHz)

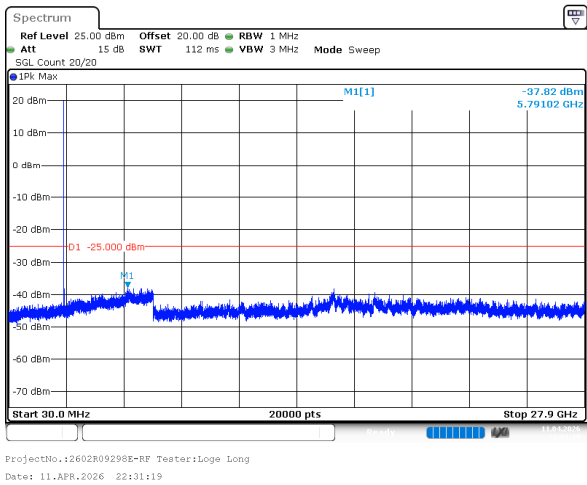


15MHz_Low_QPSK_1@0(30MHz~27.9GHz)

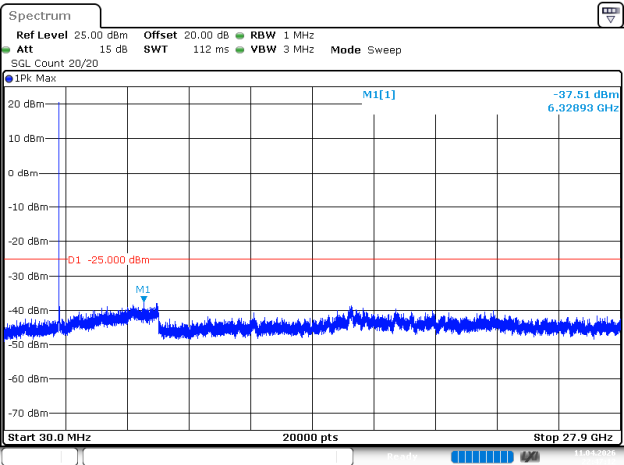


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:47:12

15MHz_Middle_QPSK_1@0(30MHz~27.9GHz)

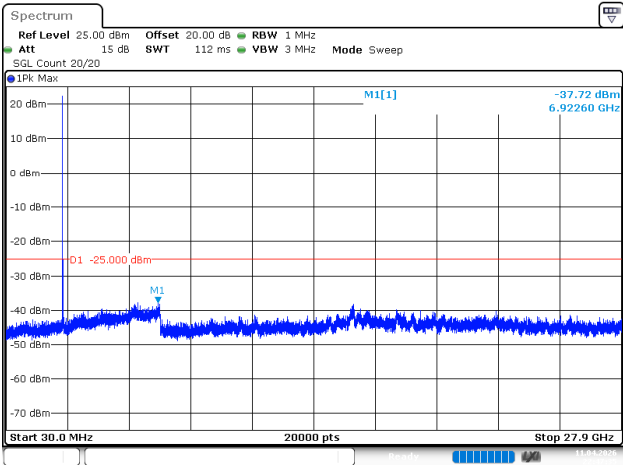


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:47:35

15MHz_High_QPSK_1@0(30MHz~27.9GHz)

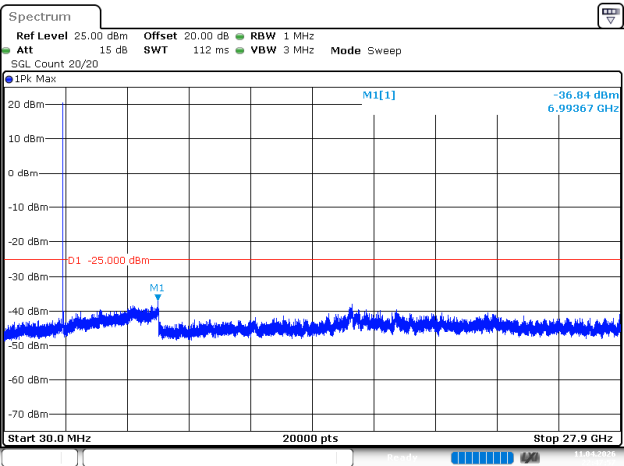


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:47:57

20MHz_Low_QPSK_1@0(30MHz~27.9GHz)

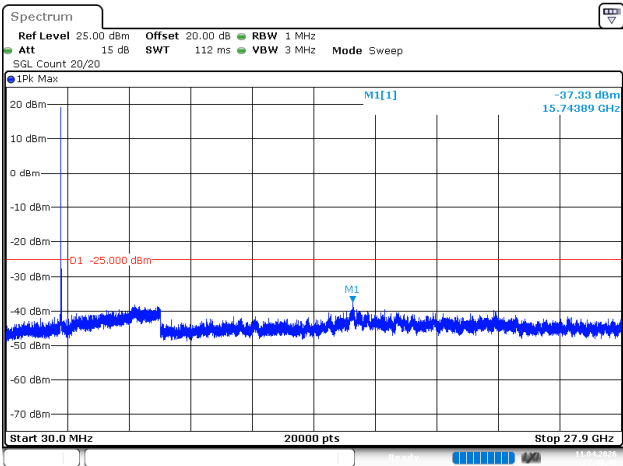


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:48:49

20MHz_Middle_QPSK_1@0(30MHz~27.9GHz)

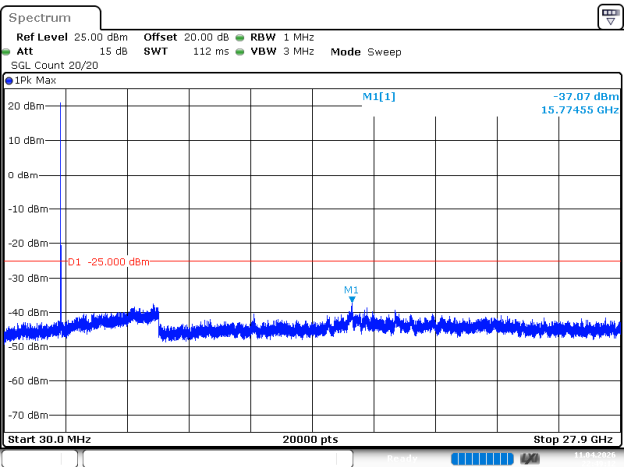

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:49:12

20MHz_High_QPSK_1@0(30MHz~27.9GHz)

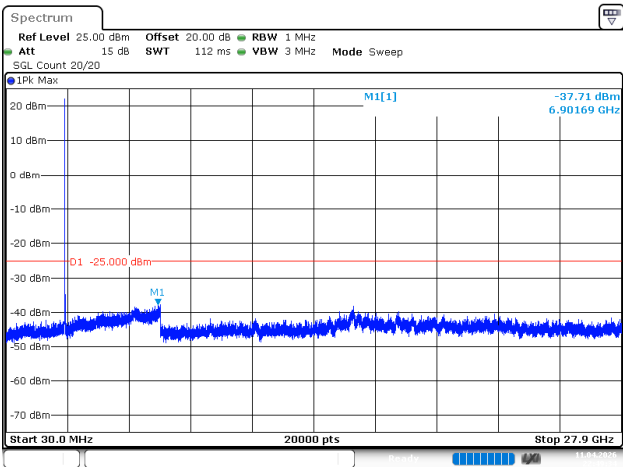


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 11.APR.2026 22:49:34


LTE Band 66, Normal

1RB was the worst case


1.4MHz_Low_QPSK_1@0(30MHz~18.8GHz)

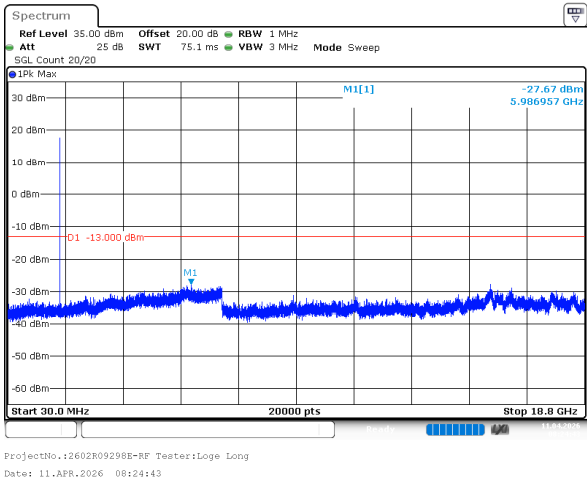


1.4MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

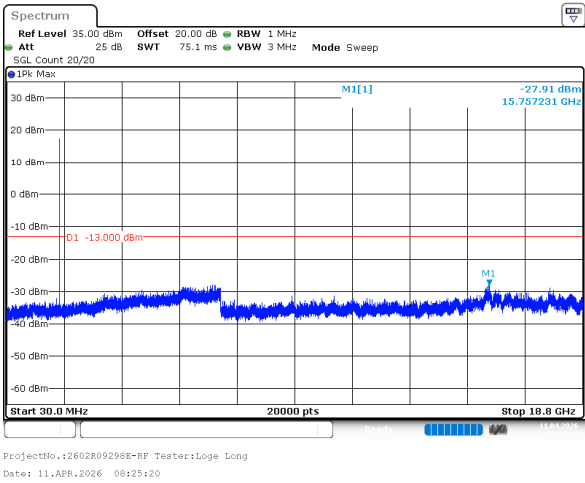


1.4MHz_High_QPSK_1@0(30MHz~18.8GHz)

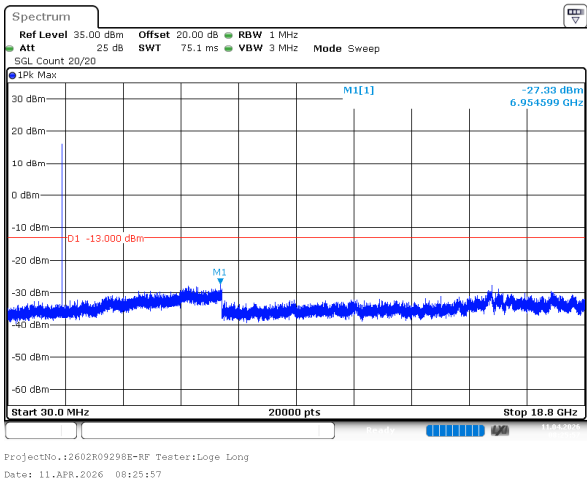

3MHz_Low_QPSK_1@0(30MHz~18.8GHz)

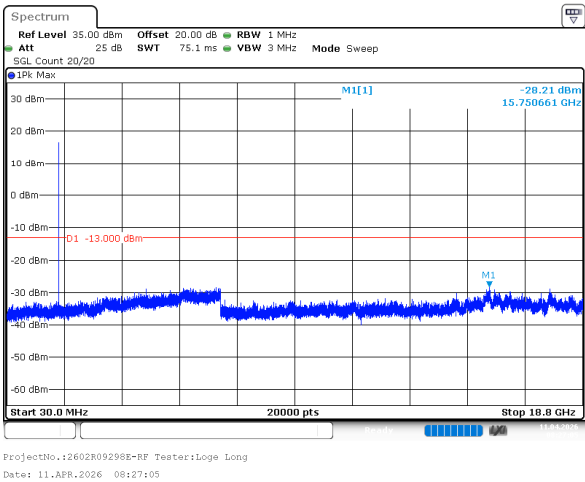

3MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

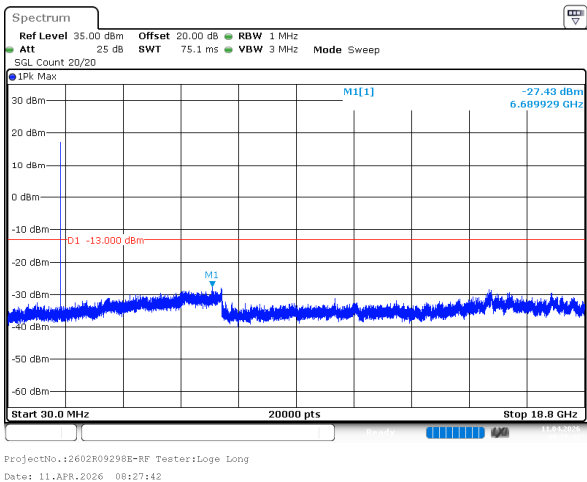

3MHz_High_QPSK_1@0(30MHz~18.8GHz)

