

Appendix Test Data

Report No.:	1812C50435512504	Test Sample No.:	1-2-2
Start Test Date:	2025-9-5	Finish Test Date:	2025-9-16
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	22.9°C	Relative Humidity:	54%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant0	5180	17.60	5171.24	5188.84	---	---
11A	Ant1	5180	17.48	5171.24	5188.72	---	---
11A	Ant0	5200	17.96	5191.04	5209.00	---	---
11A	Ant1	5200	18.12	5191.04	5209.16	---	---
11A	Ant0	5240	18.08	5231.04	5249.12	---	---
11A	Ant1	5240	18.12	5230.92	5249.04	---	---
11A	Ant0	5745	18.00	5736.08	5754.08	---	---
11A	Ant1	5745	18.12	5735.96	5754.08	---	---
11A	Ant0	5785	17.96	5776.04	5794.00	---	---
11A	Ant1	5785	18.00	5776.00	5794.00	---	---
11A	Ant0	5825	18.00	5816.08	5834.08	---	---
11A	Ant1	5825	18.04	5816.00	5834.04	---	---
11N20MIMO	Ant0	5180	18.68	5170.68	5189.36	---	---
11N20MIMO	Ant1	5180	18.68	5170.68	5189.36	---	---
11N20MIMO	Ant0	5200	18.56	5190.76	5209.32	---	---
11N20MIMO	Ant1	5200	18.80	5190.64	5209.44	---	---
11N20MIMO	Ant0	5240	18.72	5230.68	5249.40	---	---
11N20MIMO	Ant1	5240	18.64	5230.72	5249.36	---	---
11N20MIMO	Ant0	5745	18.60	5735.76	5754.36	---	---
11N20MIMO	Ant1	5745	18.80	5735.64	5754.44	---	---
11N20MIMO	Ant0	5785	18.60	5775.68	5794.28	---	---
11N20MIMO	Ant1	5785	18.64	5775.72	5794.36	---	---
11N20MIMO	Ant0	5825	18.72	5815.64	5834.36	---	---
11N20MIMO	Ant1	5825	18.68	5815.68	5834.36	---	---
11N40MIMO	Ant0	5190	38.32	5170.72	5209.04	---	---

11N40MIMO	Ant1	5190	38.40	5170.72	5209.12	---	---
11N40MIMO	Ant0	5230	38.24	5210.80	5249.04	---	---
11N40MIMO	Ant1	5230	38.08	5210.80	5248.88	---	---
11N40MIMO	Ant0	5755	38.24	5735.80	5774.04	---	---
11N40MIMO	Ant1	5755	38.24	5735.88	5774.12	---	---
11N40MIMO	Ant0	5795	38.24	5775.80	5814.04	---	---
11N40MIMO	Ant1	5795	38.32	5775.80	5814.12	---	---
11AC20MIMO	Ant0	5180	19.04	5170.48	5189.52	---	---
11AC20MIMO	Ant1	5180	19.12	5170.44	5189.56	---	---
11AC20MIMO	Ant0	5200	19.00	5190.52	5209.52	---	---
11AC20MIMO	Ant1	5200	19.04	5190.40	5209.44	---	---
11AC20MIMO	Ant0	5240	19.08	5230.44	5249.52	---	---
11AC20MIMO	Ant1	5240	18.96	5230.56	5249.52	---	---
11AC20MIMO	Ant0	5745	19.16	5735.36	5754.52	---	---
11AC20MIMO	Ant1	5745	19.08	5735.48	5754.56	---	---
11AC20MIMO	Ant0	5785	19.32	5775.28	5794.60	---	---
11AC20MIMO	Ant1	5785	19.08	5775.44	5794.52	---	---
11AC20MIMO	Ant0	5825	19.08	5815.40	5834.48	---	---
11AC20MIMO	Ant1	5825	19.04	5815.52	5834.56	---	---
11AC40MIMO	Ant0	5190	38.56	5170.88	5209.44	---	---
11AC40MIMO	Ant1	5190	38.24	5170.88	5209.12	---	---
11AC40MIMO	Ant0	5230	38.48	5210.80	5249.28	---	---
11AC40MIMO	Ant1	5230	38.40	5210.80	5249.20	---	---
11AC40MIMO	Ant0	5755	38.48	5735.88	5774.36	---	---
11AC40MIMO	Ant1	5755	38.32	5735.80	5774.12	---	---
11AC40MIMO	Ant0	5795	38.48	5775.80	5814.28	---	---
11AC40MIMO	Ant1	5795	38.40	5775.88	5814.28	---	---
11AX20MIMO	Ant0	5180	19.92	5170.04	5189.96	---	---
11AX20MIMO	Ant1	5180	20.00	5170.00	5190.00	---	---
11AX20MIMO	Ant0	5200	20.12	5189.92	5210.04	---	---
11AX20MIMO	Ant1	5200	20.00	5190.04	5210.04	---	---
11AX20MIMO	Ant0	5240	20.16	5229.96	5250.12	---	---
11AX20MIMO	Ant1	5240	20.04	5229.92	5249.96	---	---
11AX20MIMO	Ant0	5745	20.12	5734.96	5755.08	---	---
11AX20MIMO	Ant1	5745	20.12	5735.00	5755.12	---	---
11AX20MIMO	Ant0	5785	20.20	5774.92	5795.12	---	---
11AX20MIMO	Ant1	5785	20.04	5775.00	5795.04	---	---
11AX20MIMO	Ant0	5825	20.04	5814.96	5835.00	---	---
11AX20MIMO	Ant1	5825	20.16	5815.00	5835.16	---	---
11AX40MIMO	Ant0	5190	39.52	5170.24	5209.76	---	---
11AX40MIMO	Ant1	5190	39.36	5170.24	5209.60	---	---
11AX40MIMO	Ant0	5230	39.60	5210.08	5249.68	---	---


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX40MIMO	Ant1	5230	39.60	5210.24	5249.84	---	---
11AX40MIMO	Ant0	5755	39.68	5735.16	5774.84	---	---
11AX40MIMO	Ant1	5755	39.68	5735.16	5774.84	---	---
11AX40MIMO	Ant0	5795	39.68	5775.08	5814.76	---	---
11AX40MIMO	Ant1	5795	39.60	5775.24	5814.84	---	---


Test Graphs

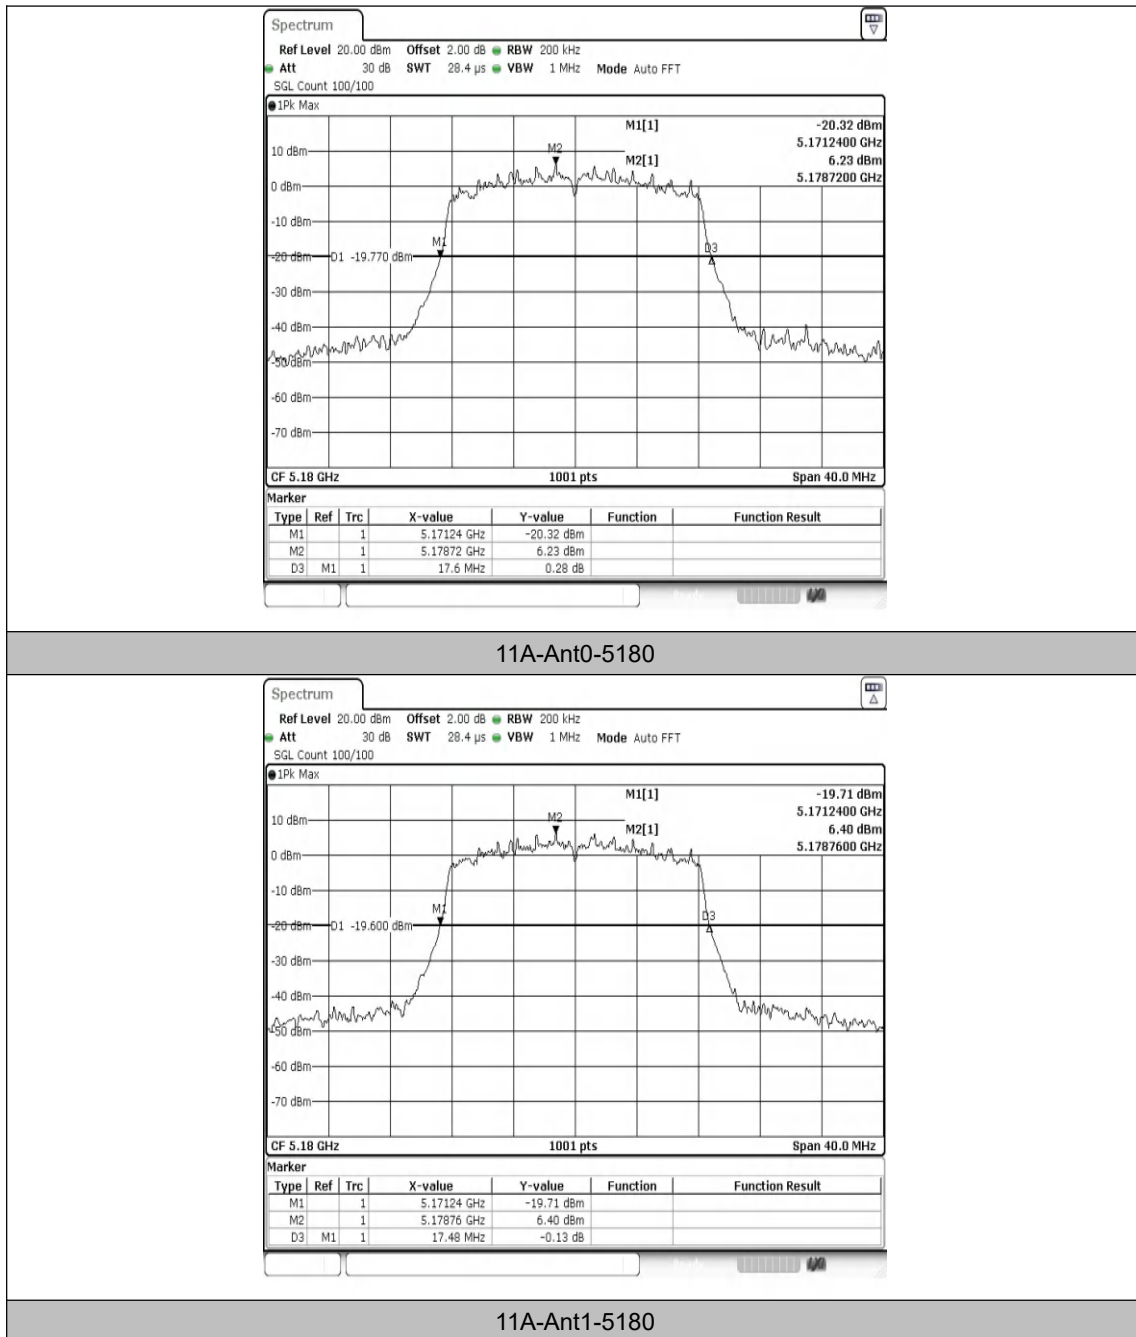


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

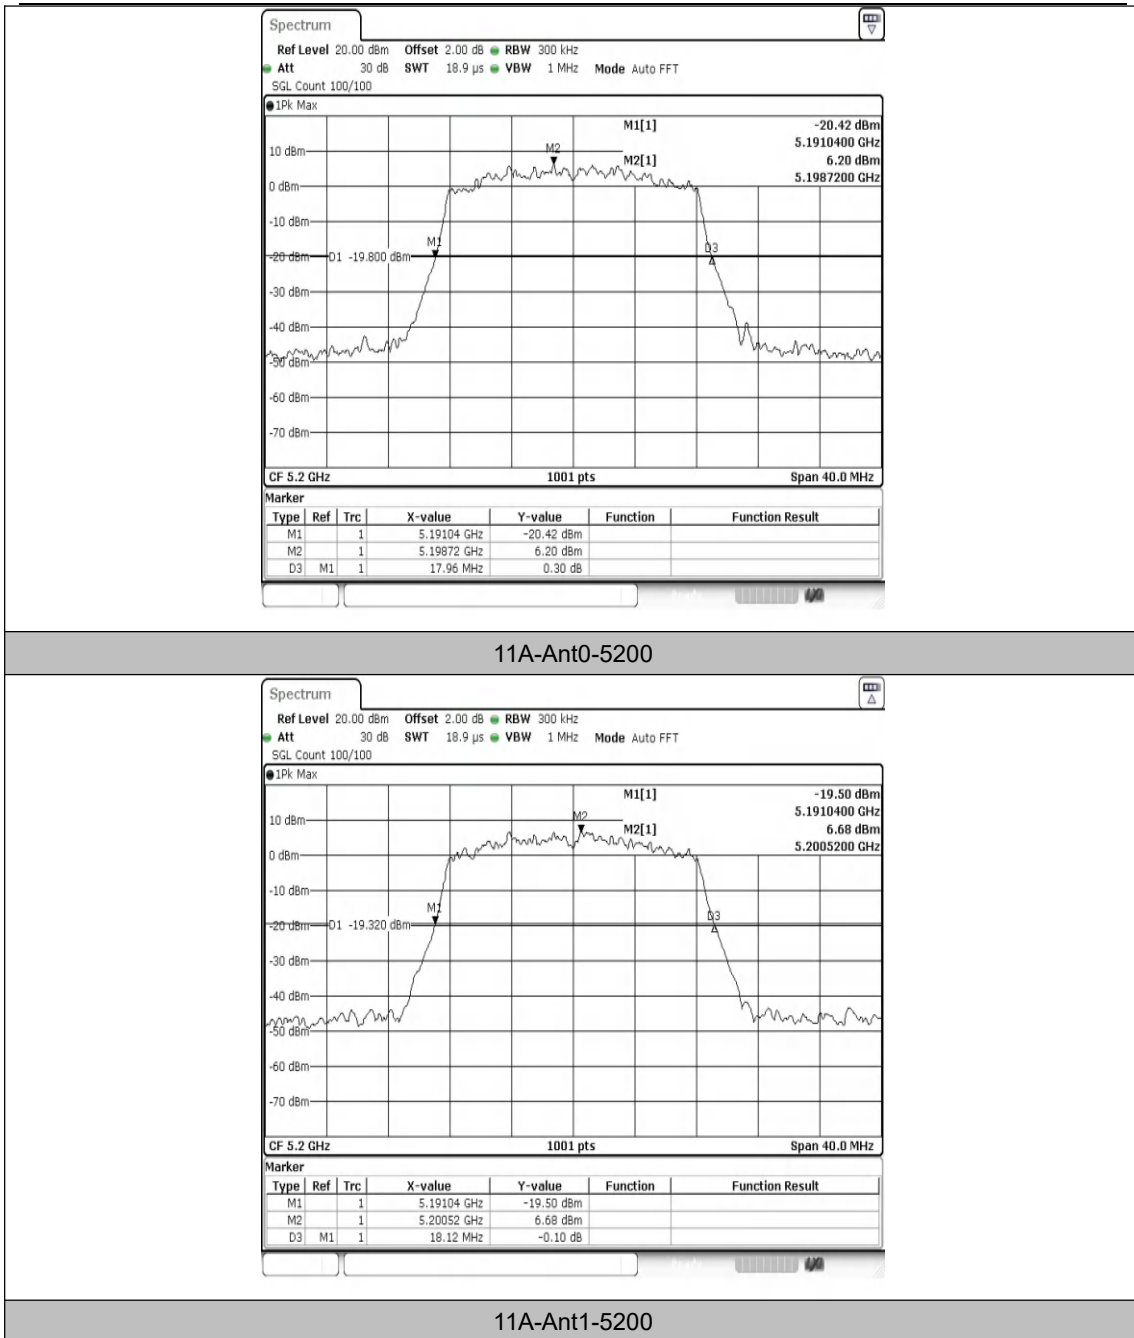


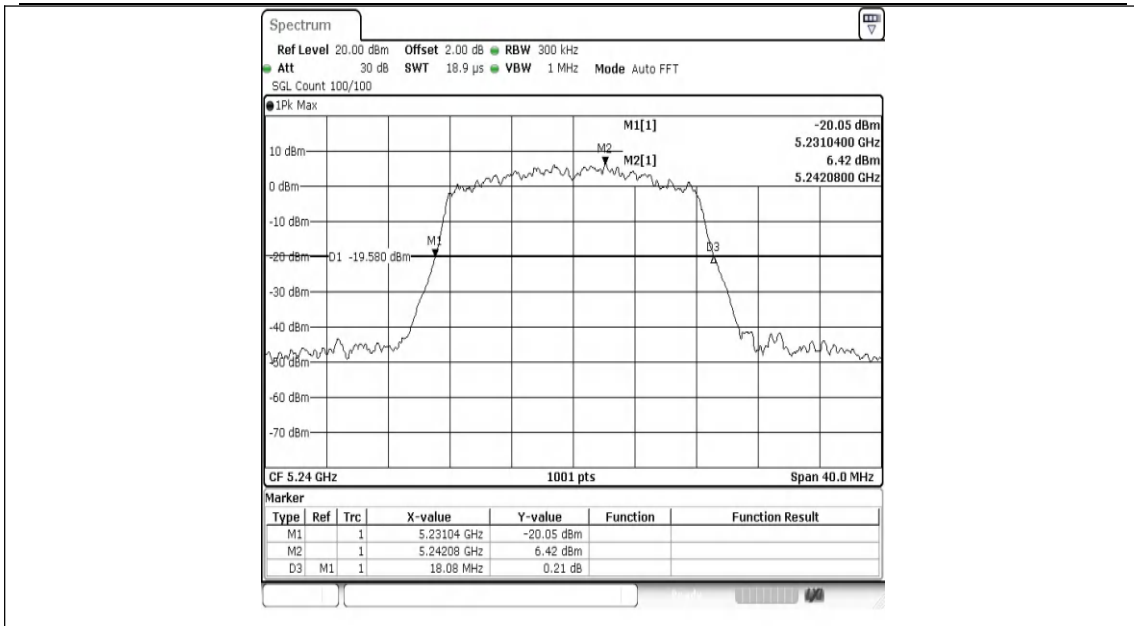


11A-Ant0-5240

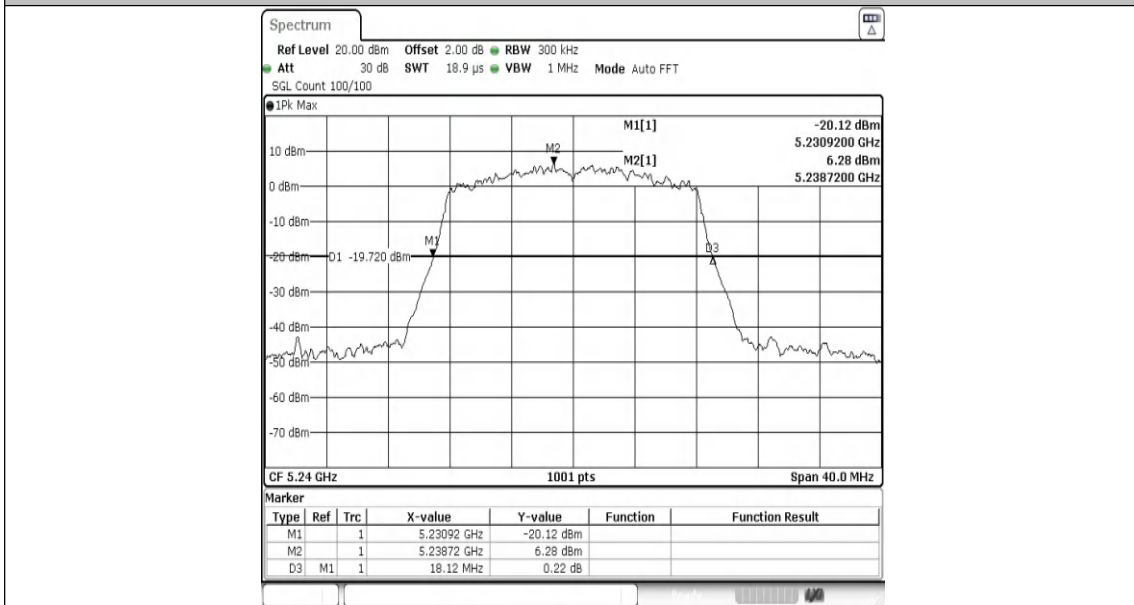


11A-Ant1-5240

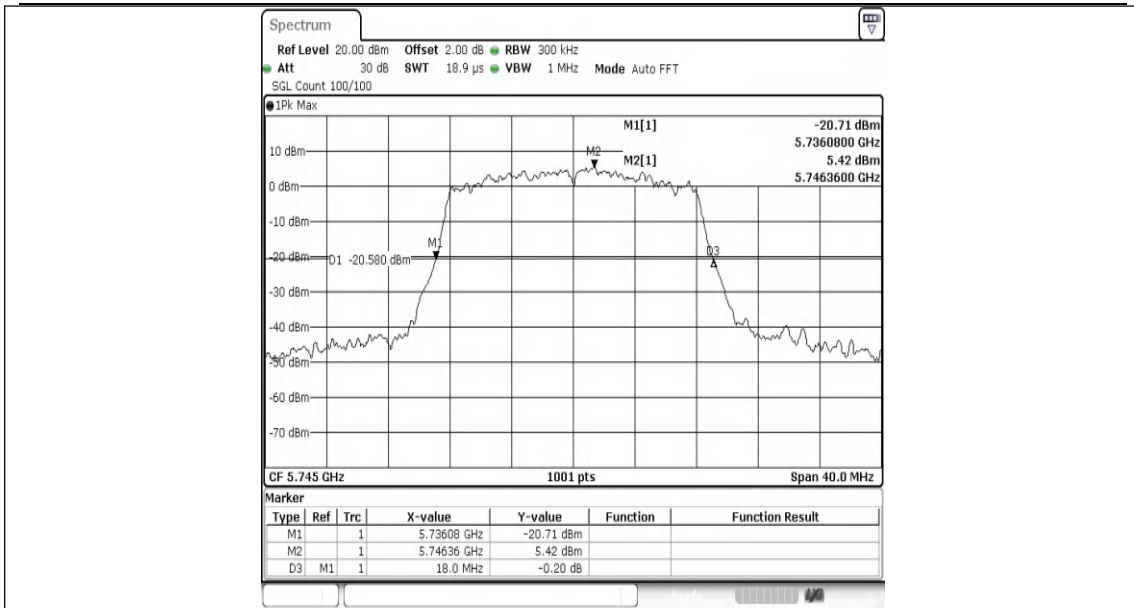


11A-Ant0-5745

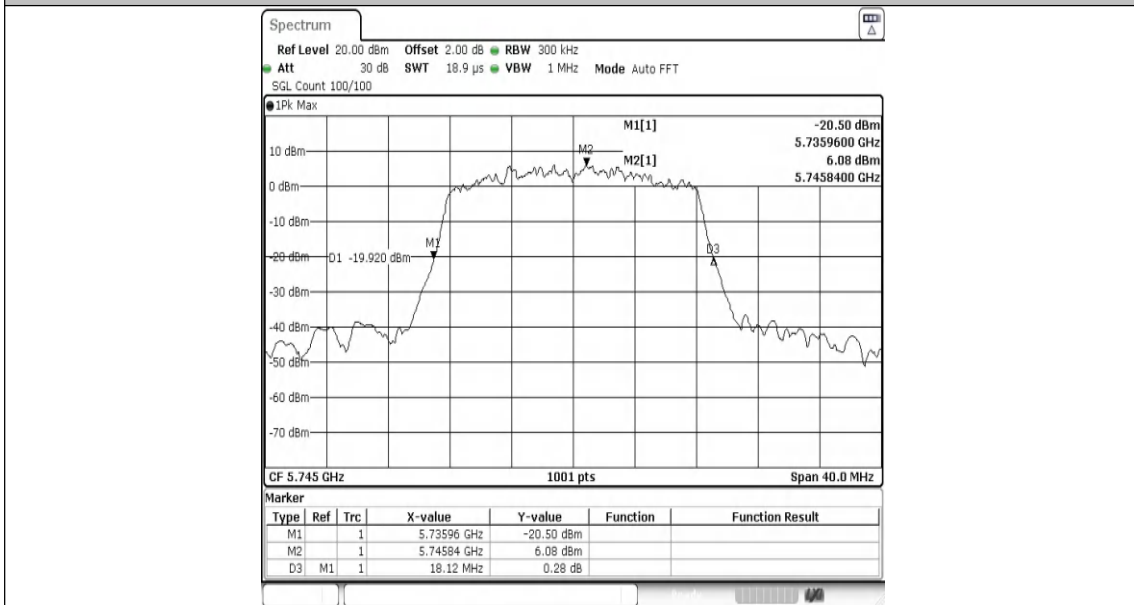


11A-Ant1-5745

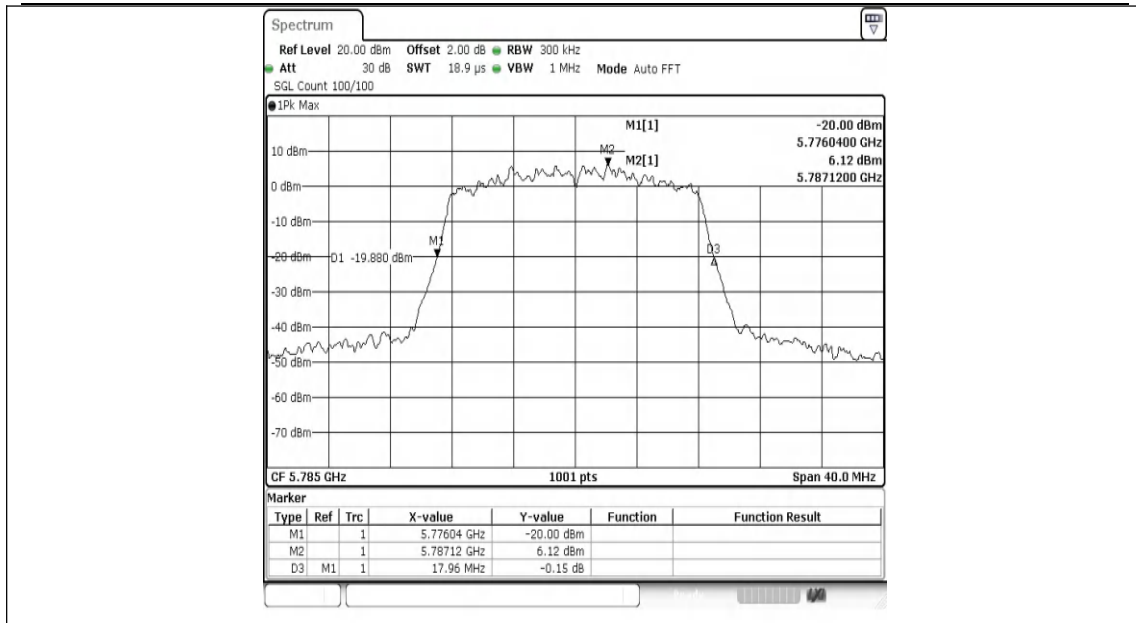



11A-Ant0-5785

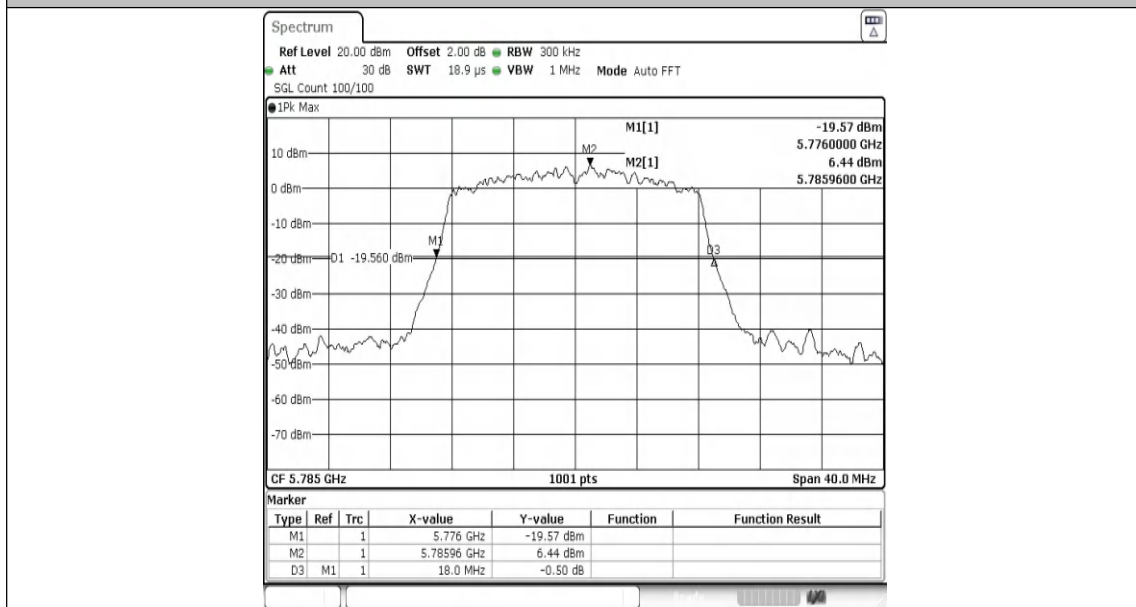


11A-Ant1-5785

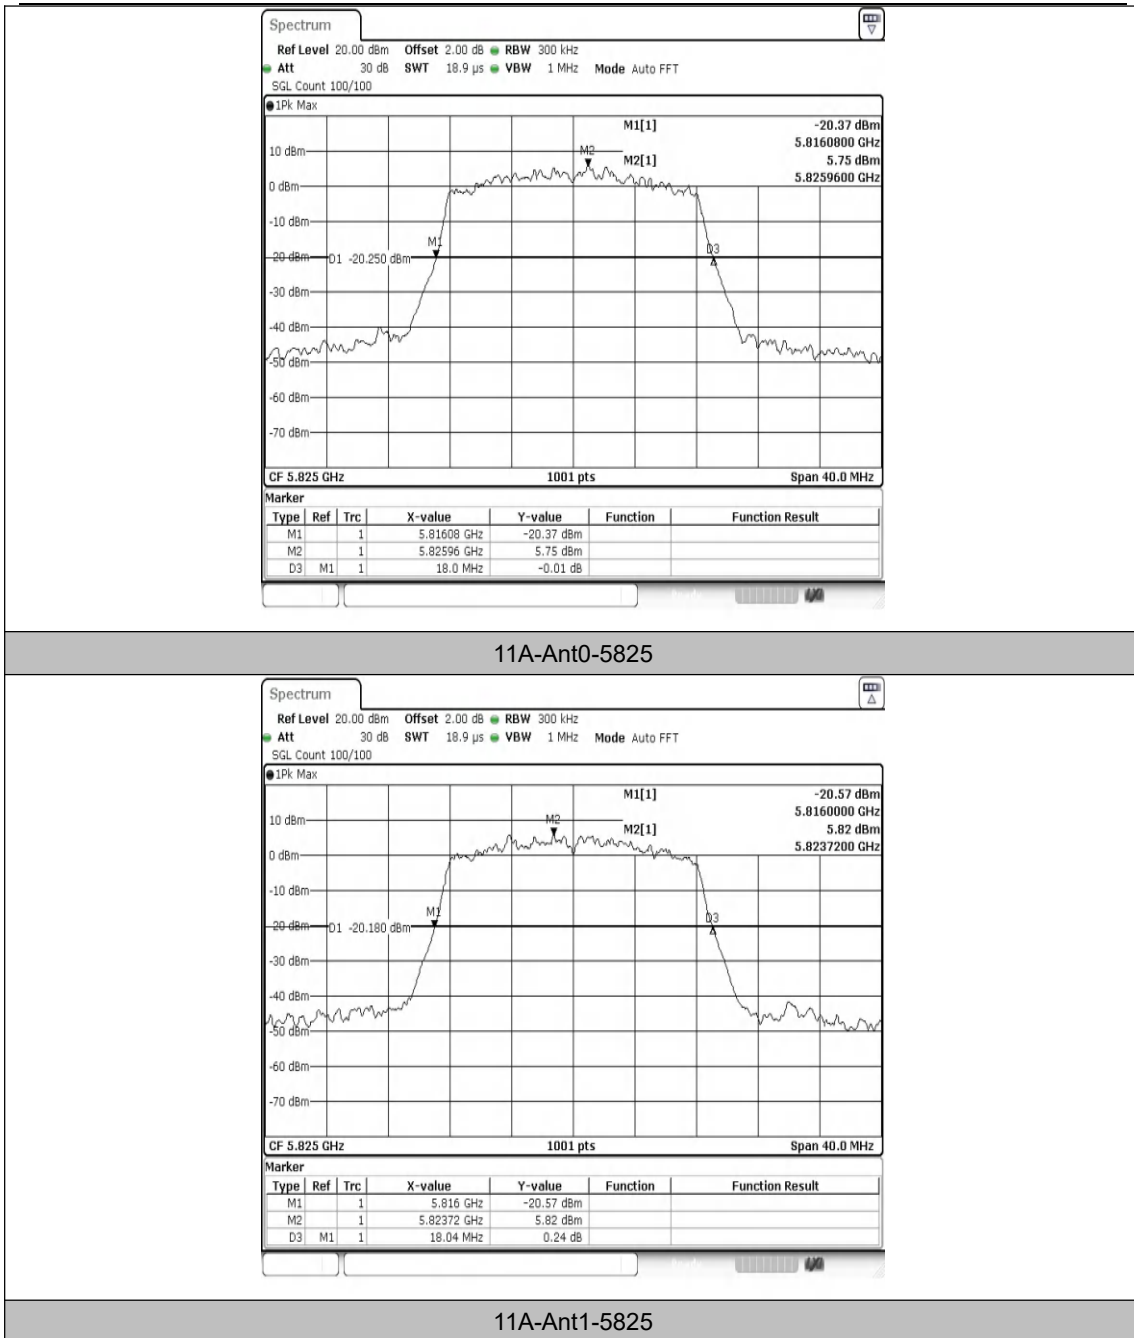

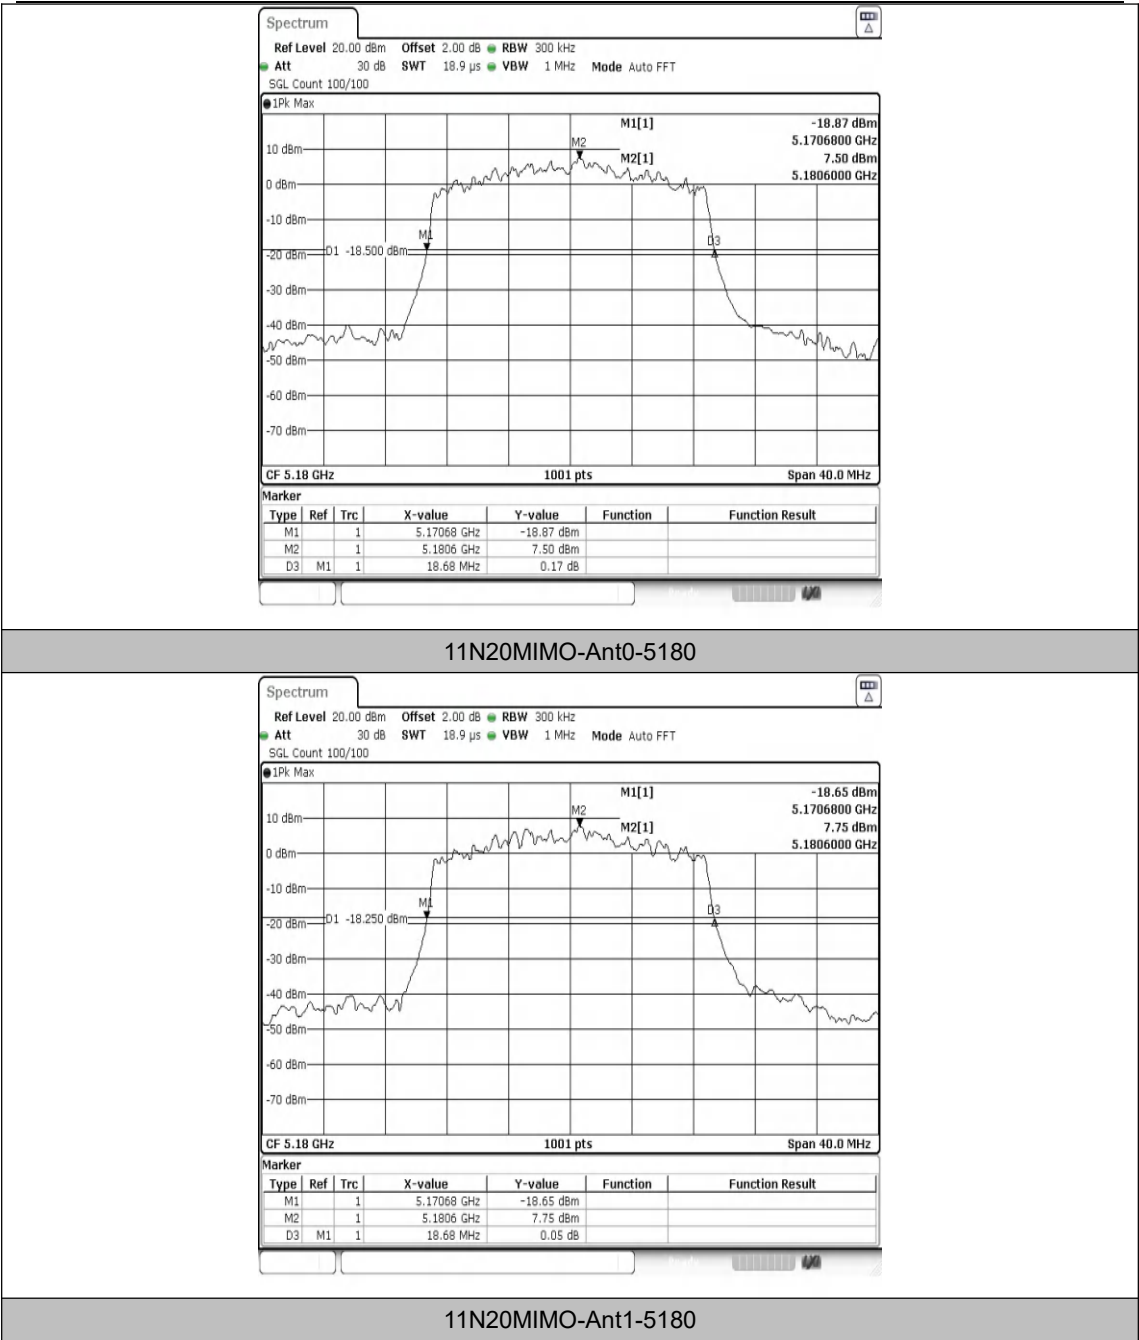

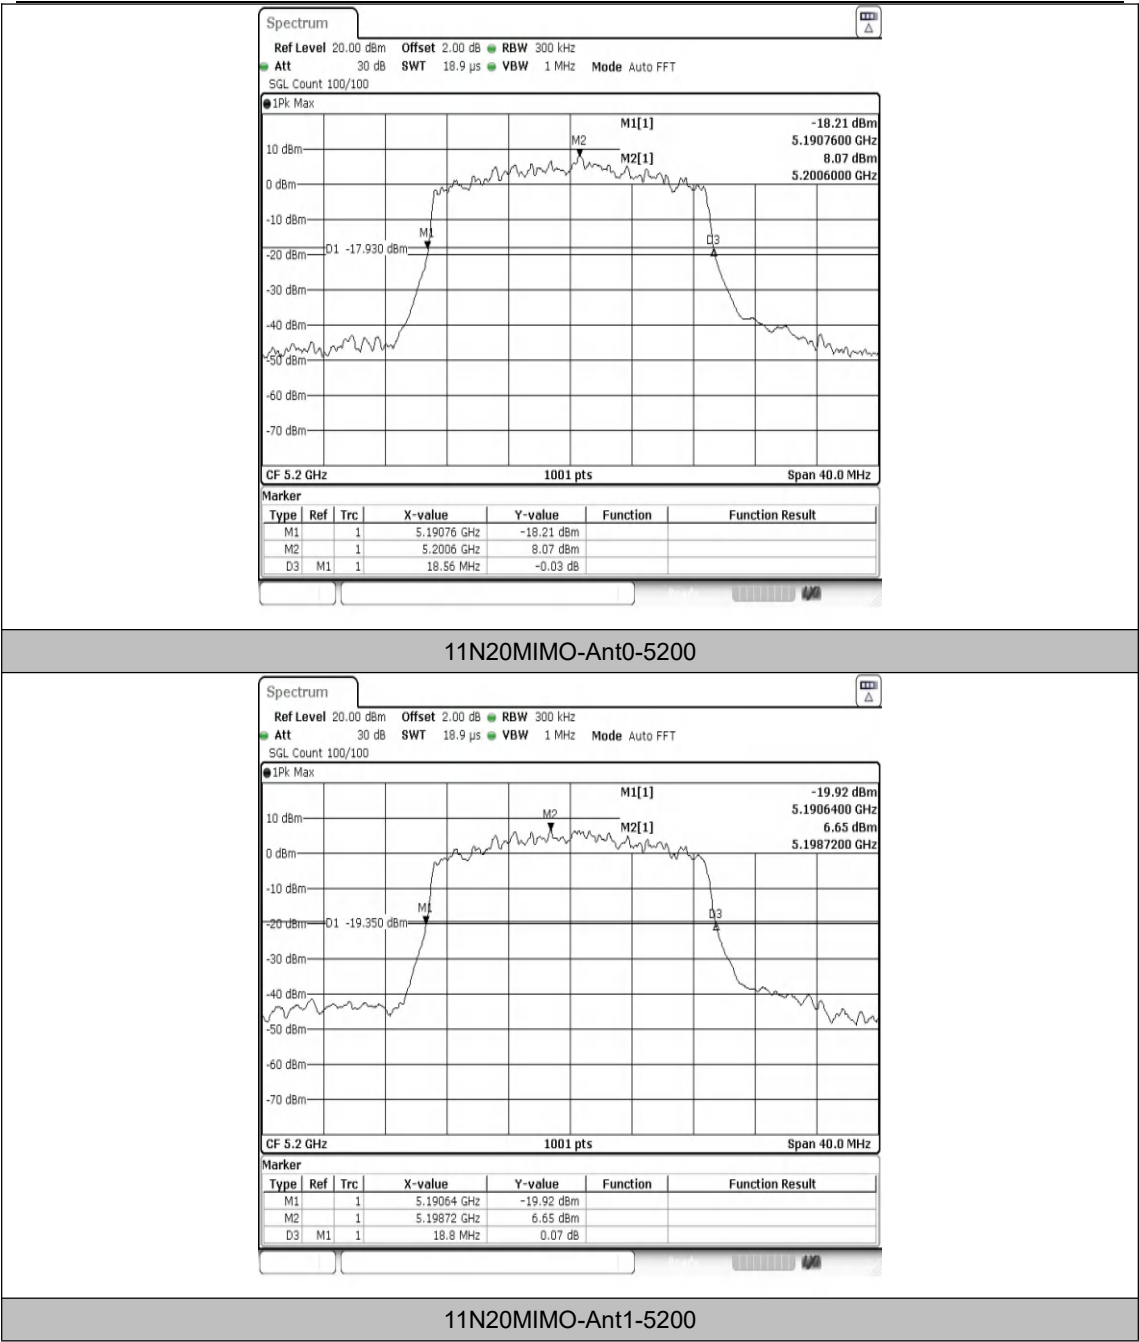


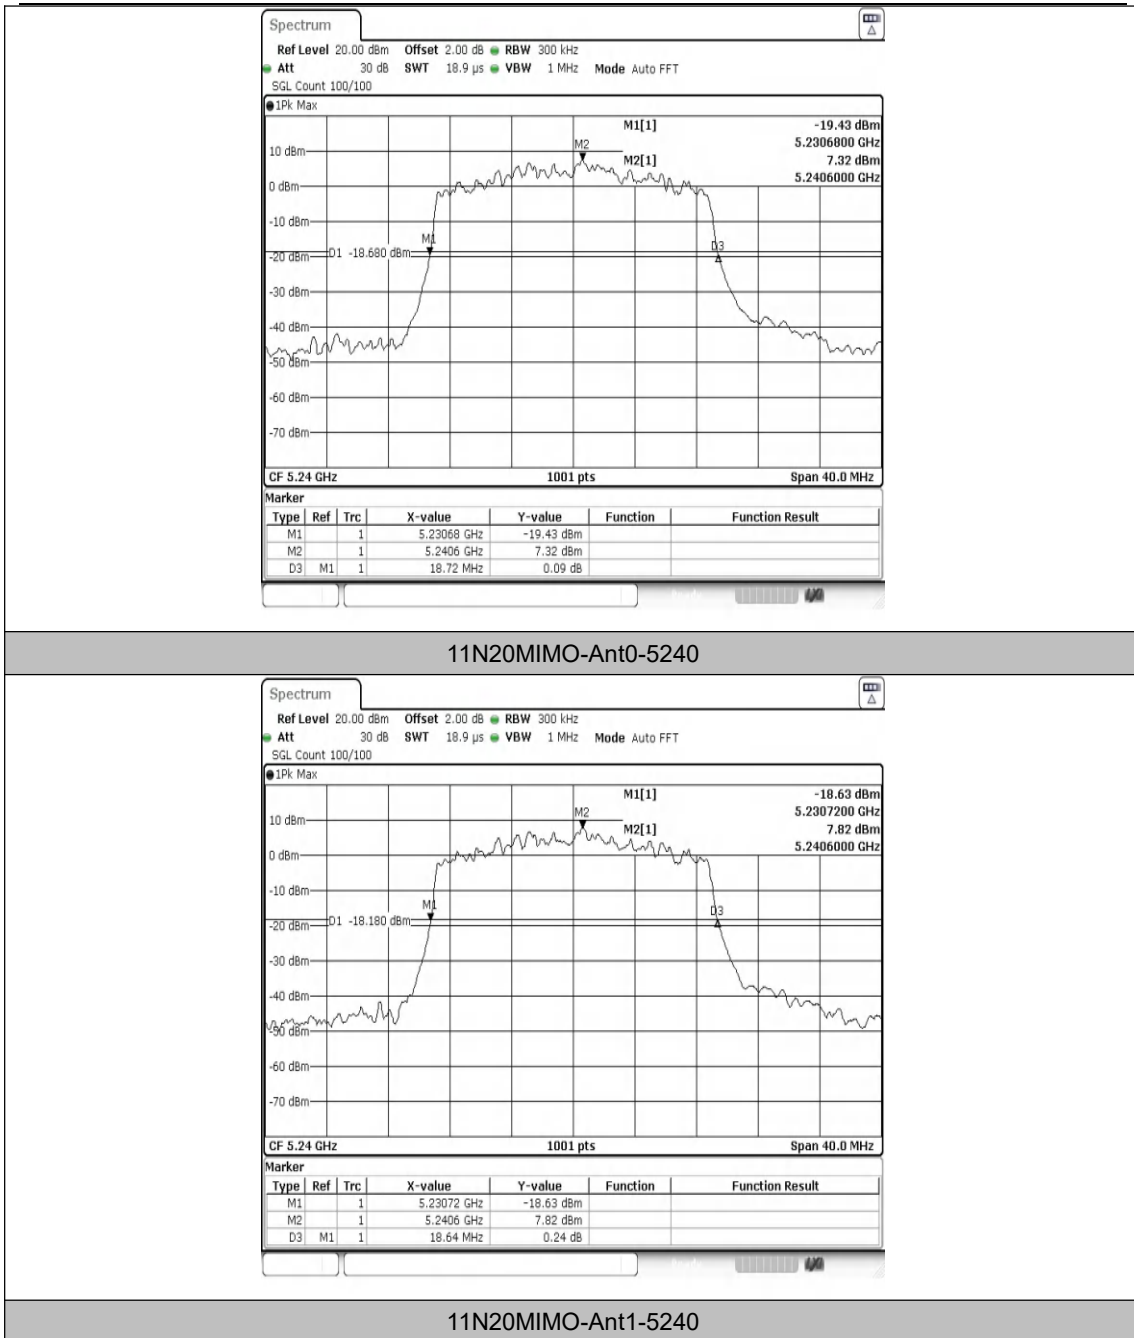



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

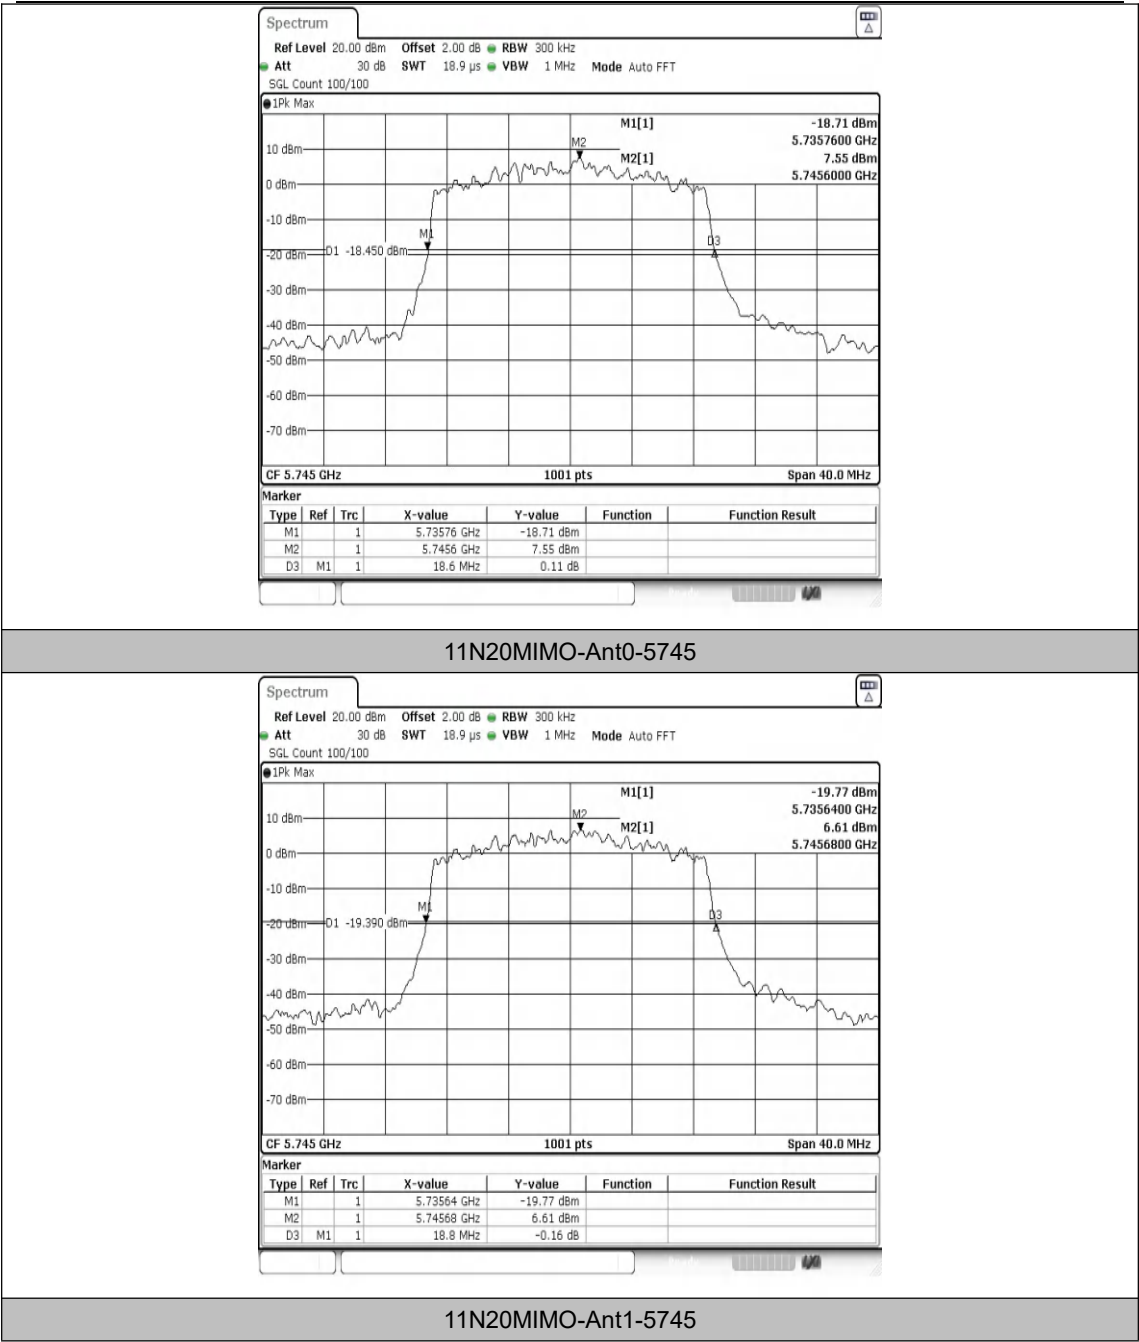


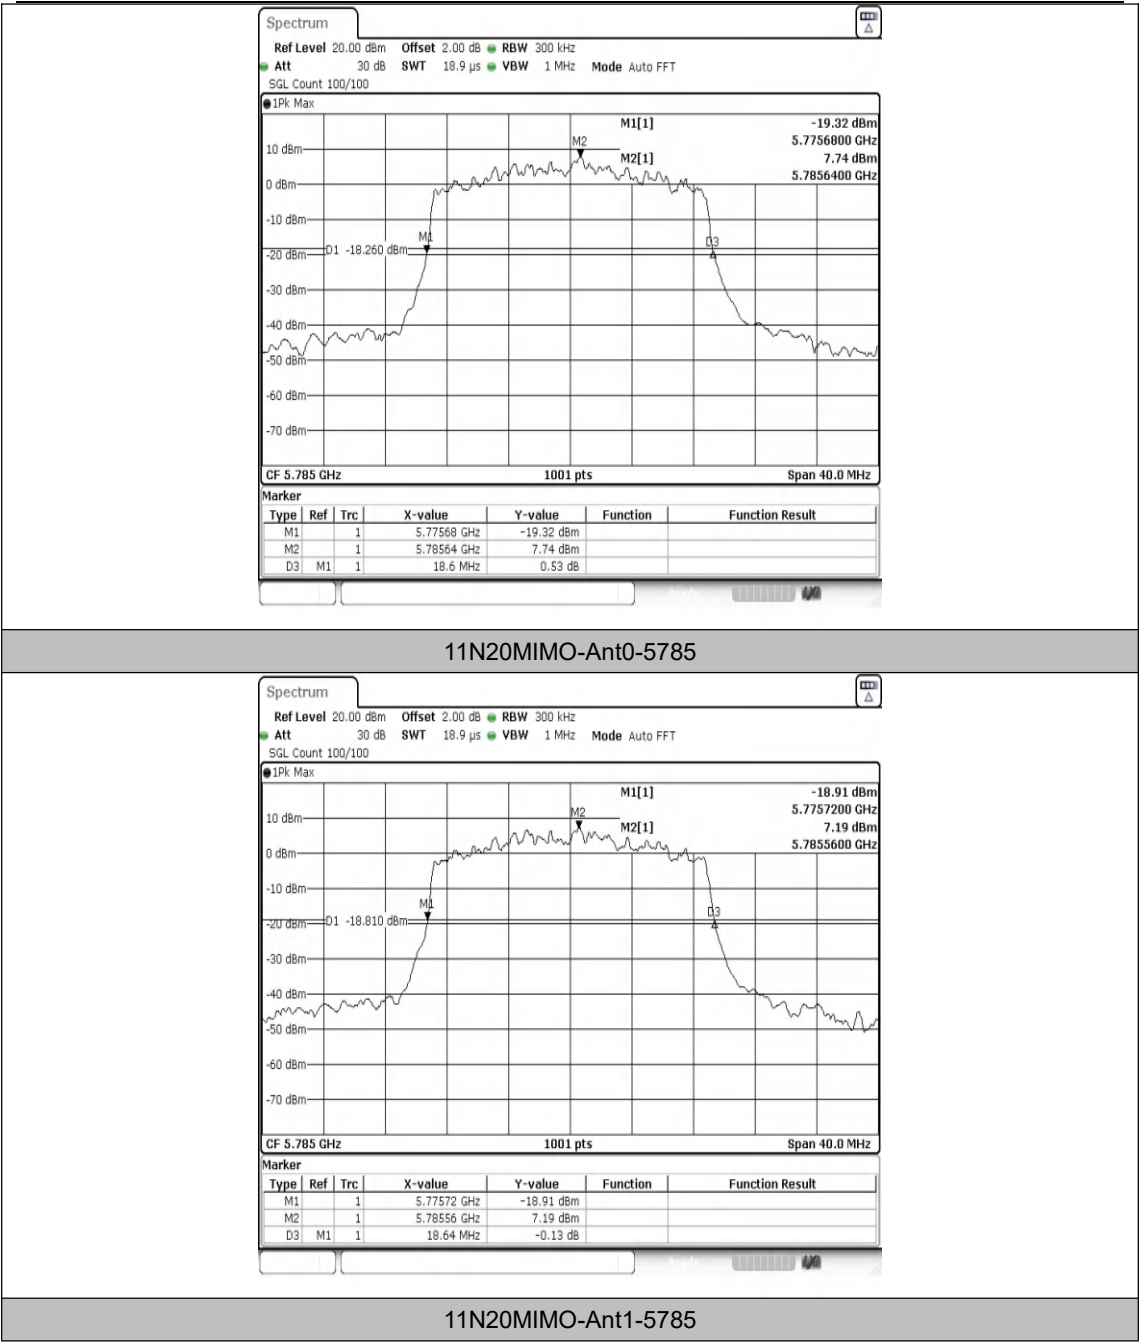


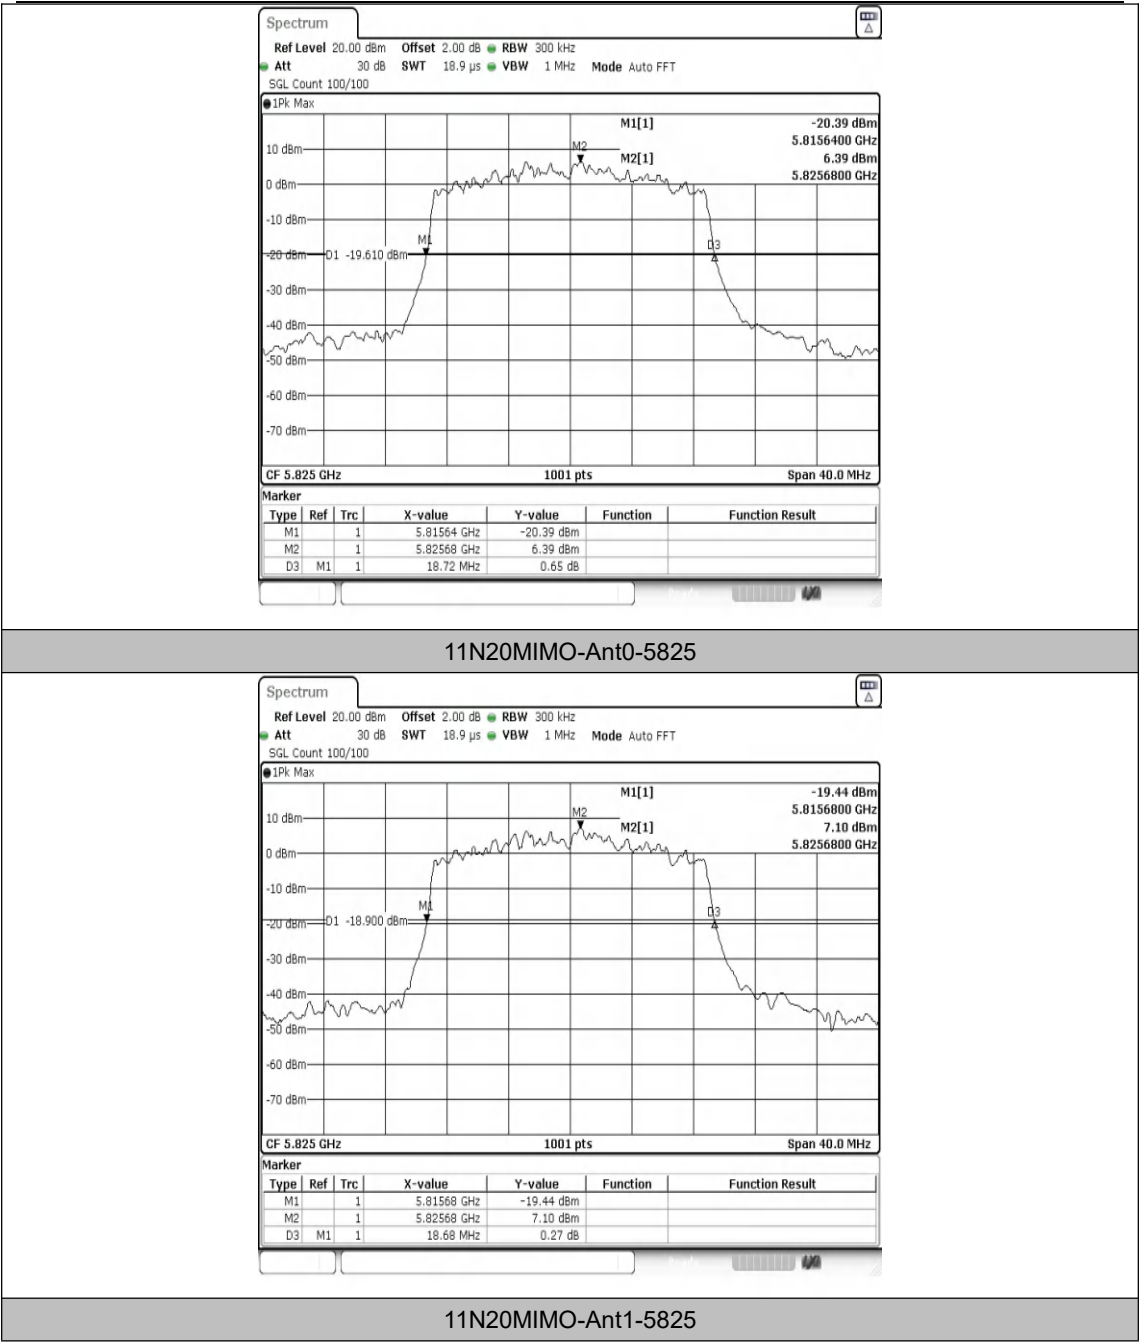


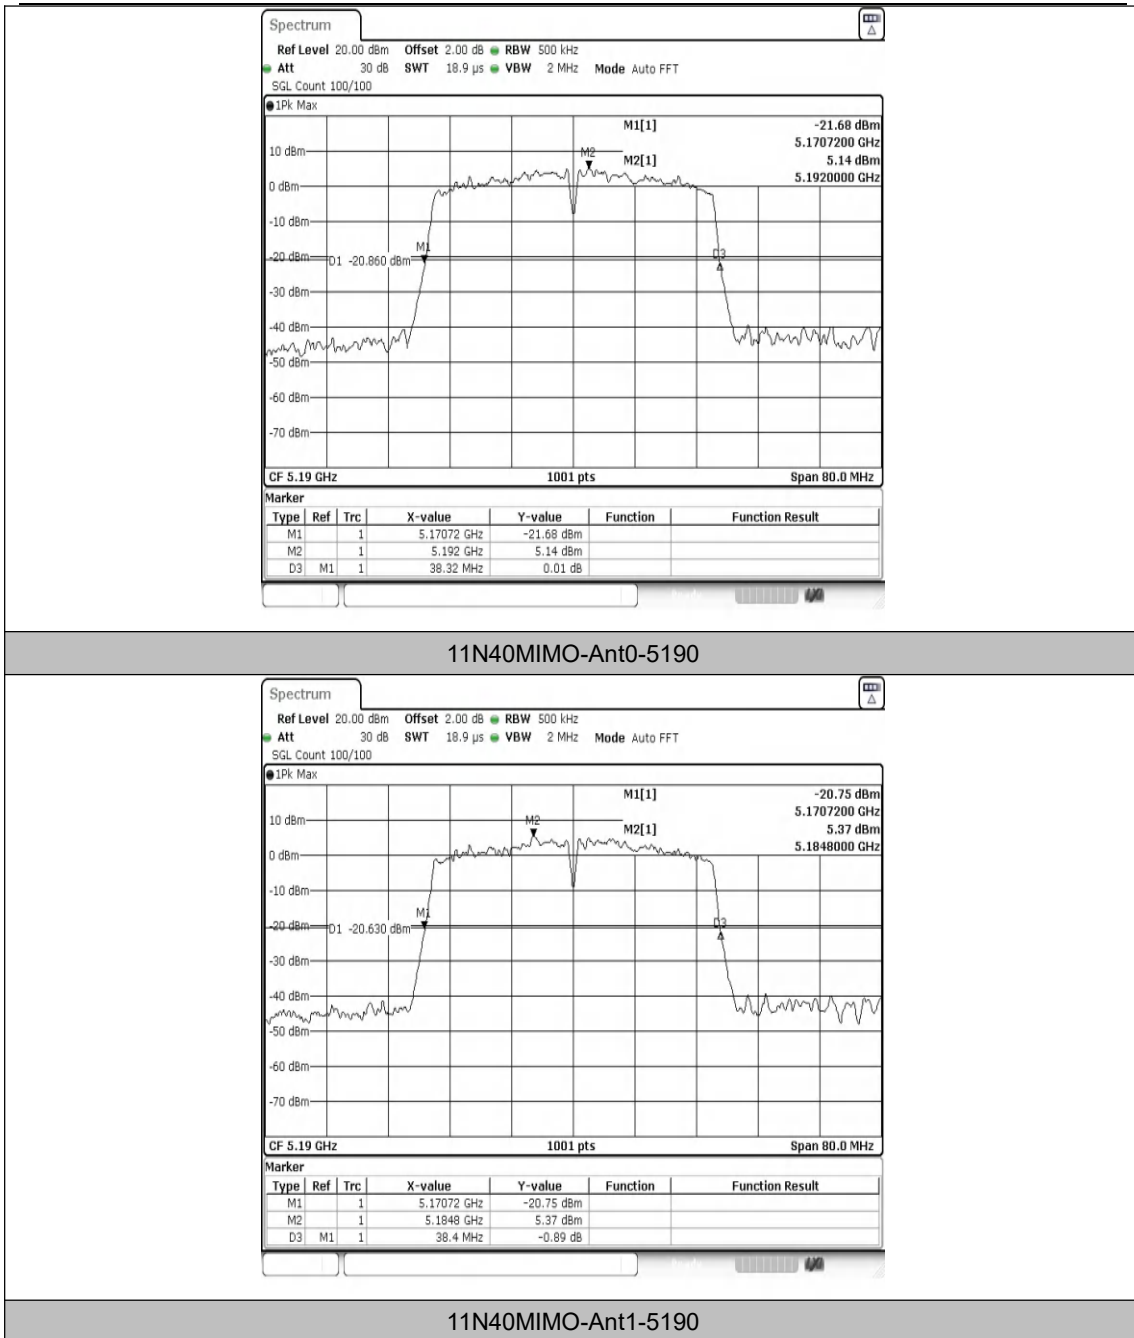


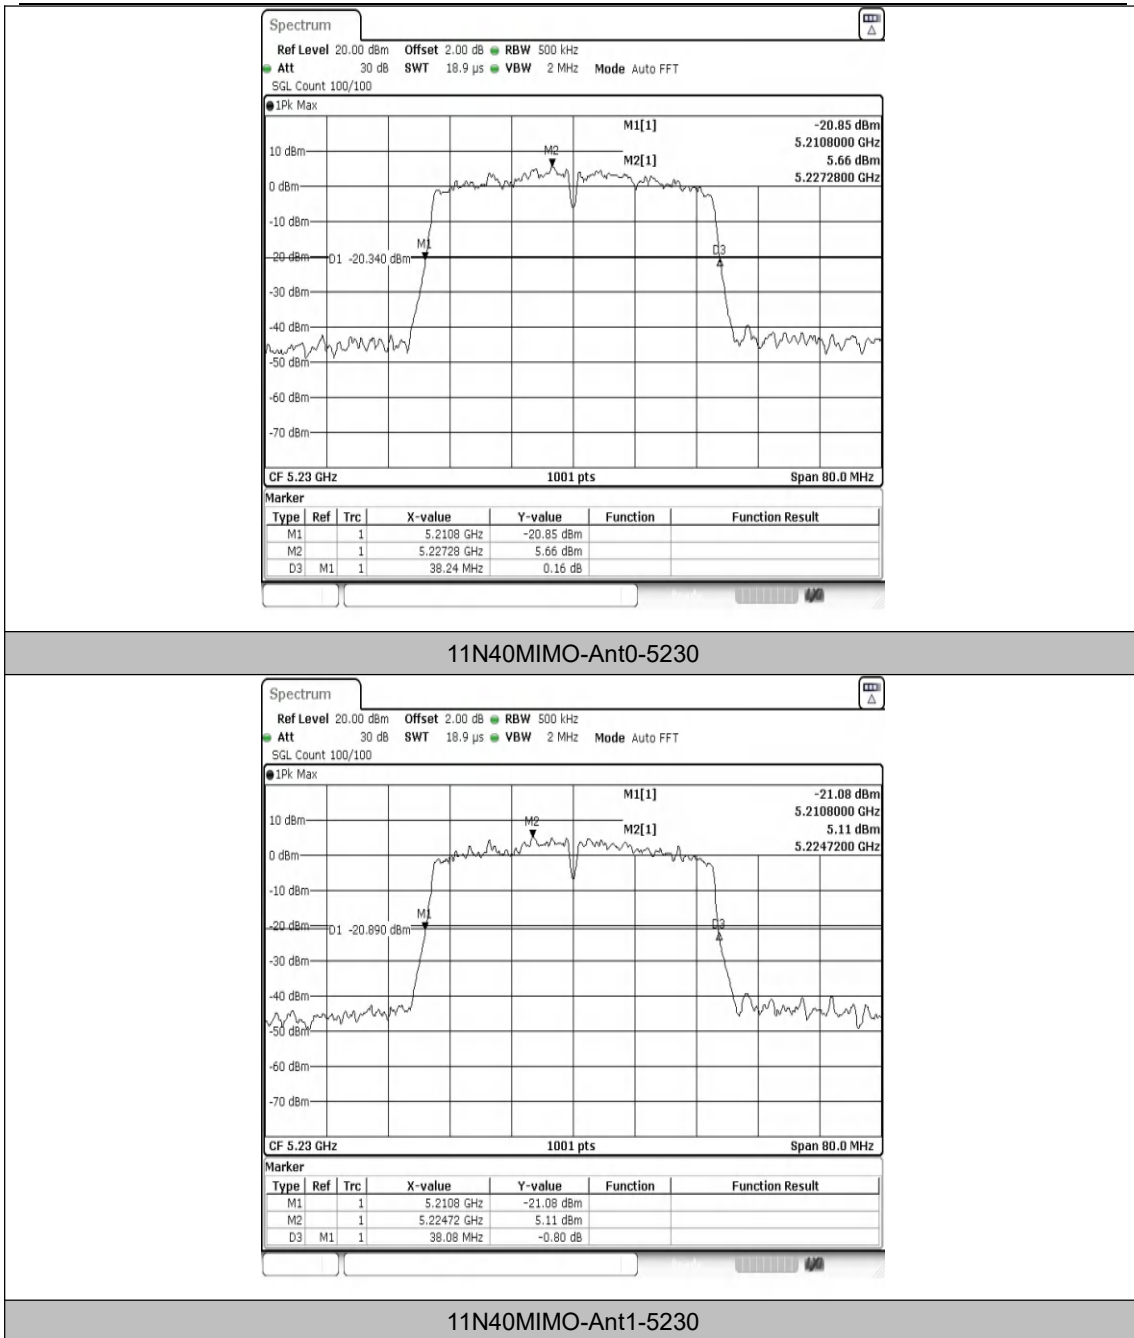


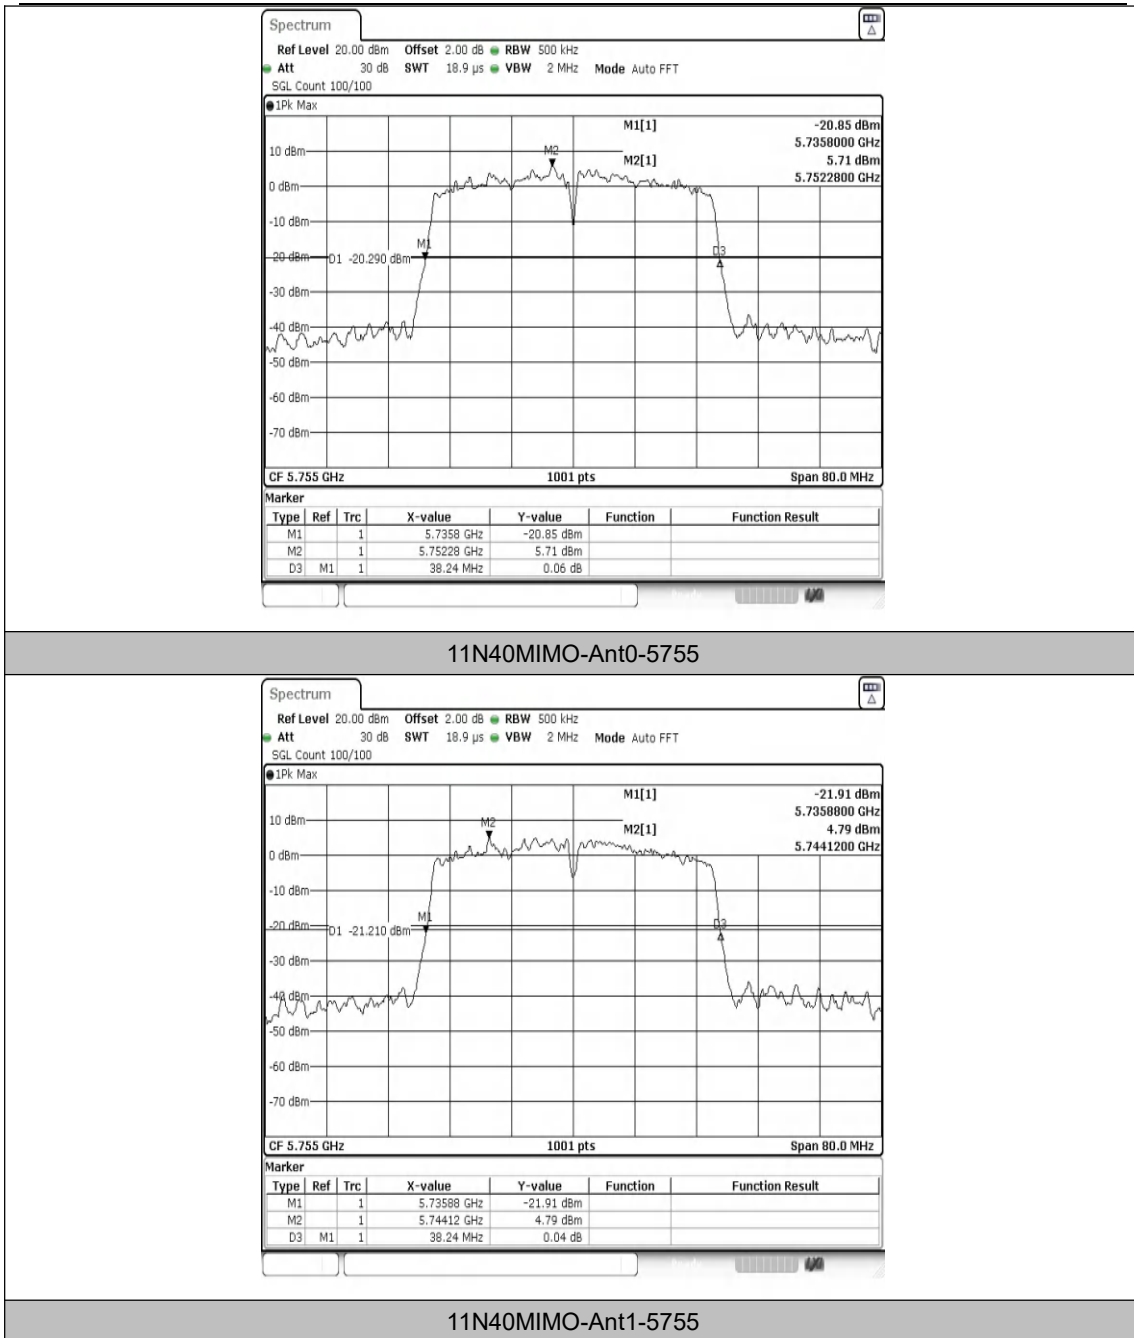


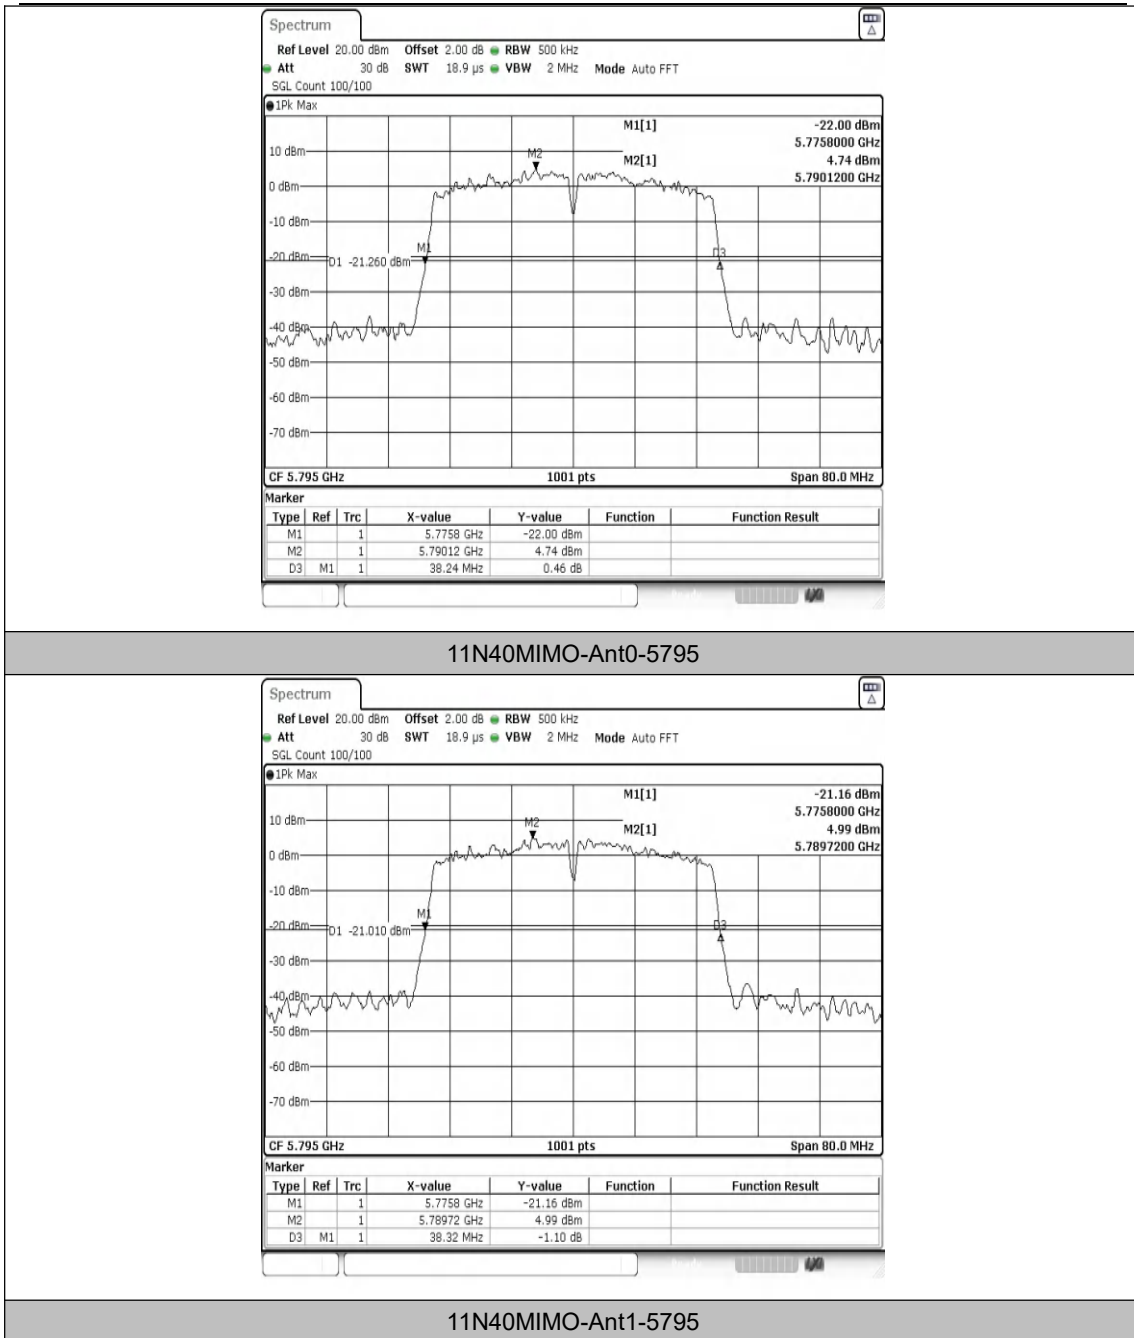


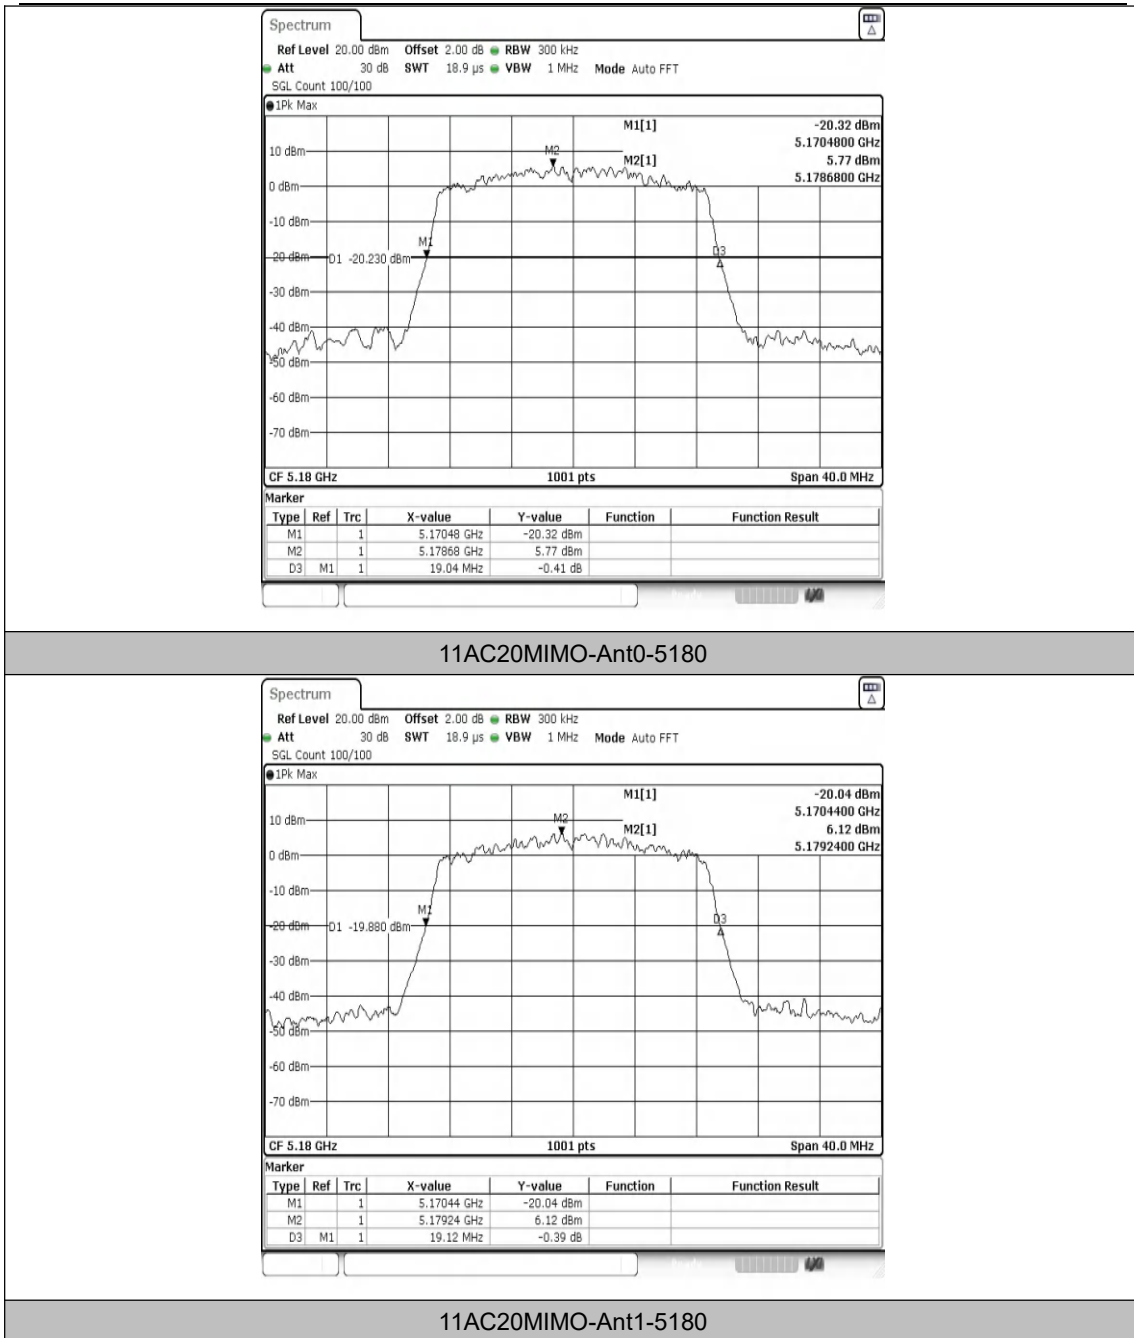


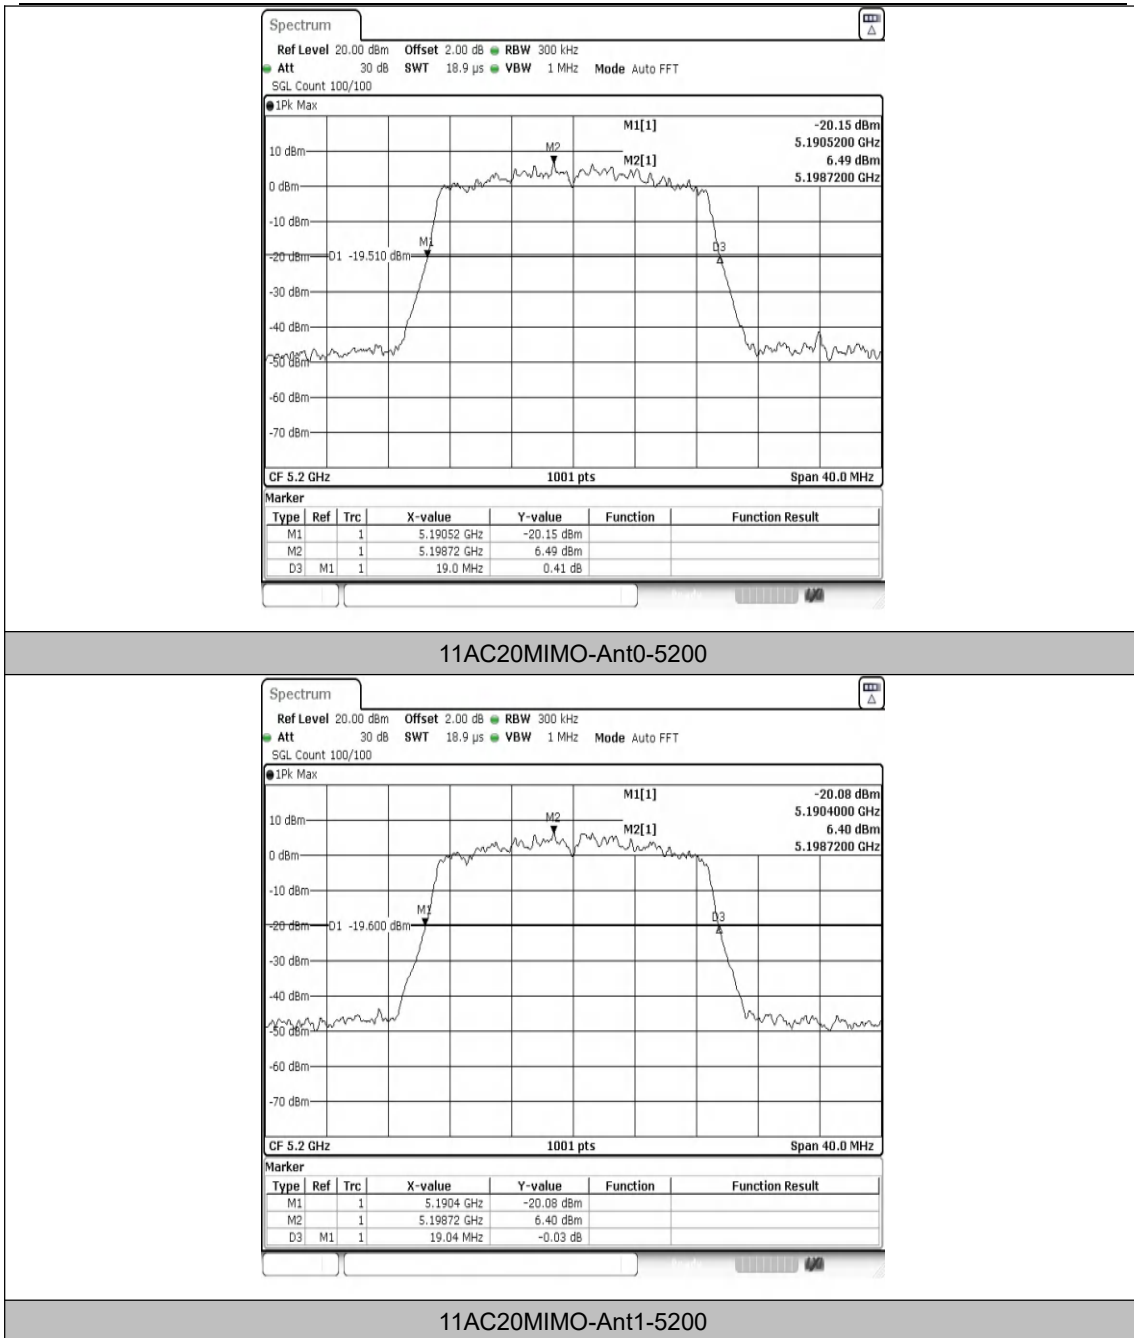

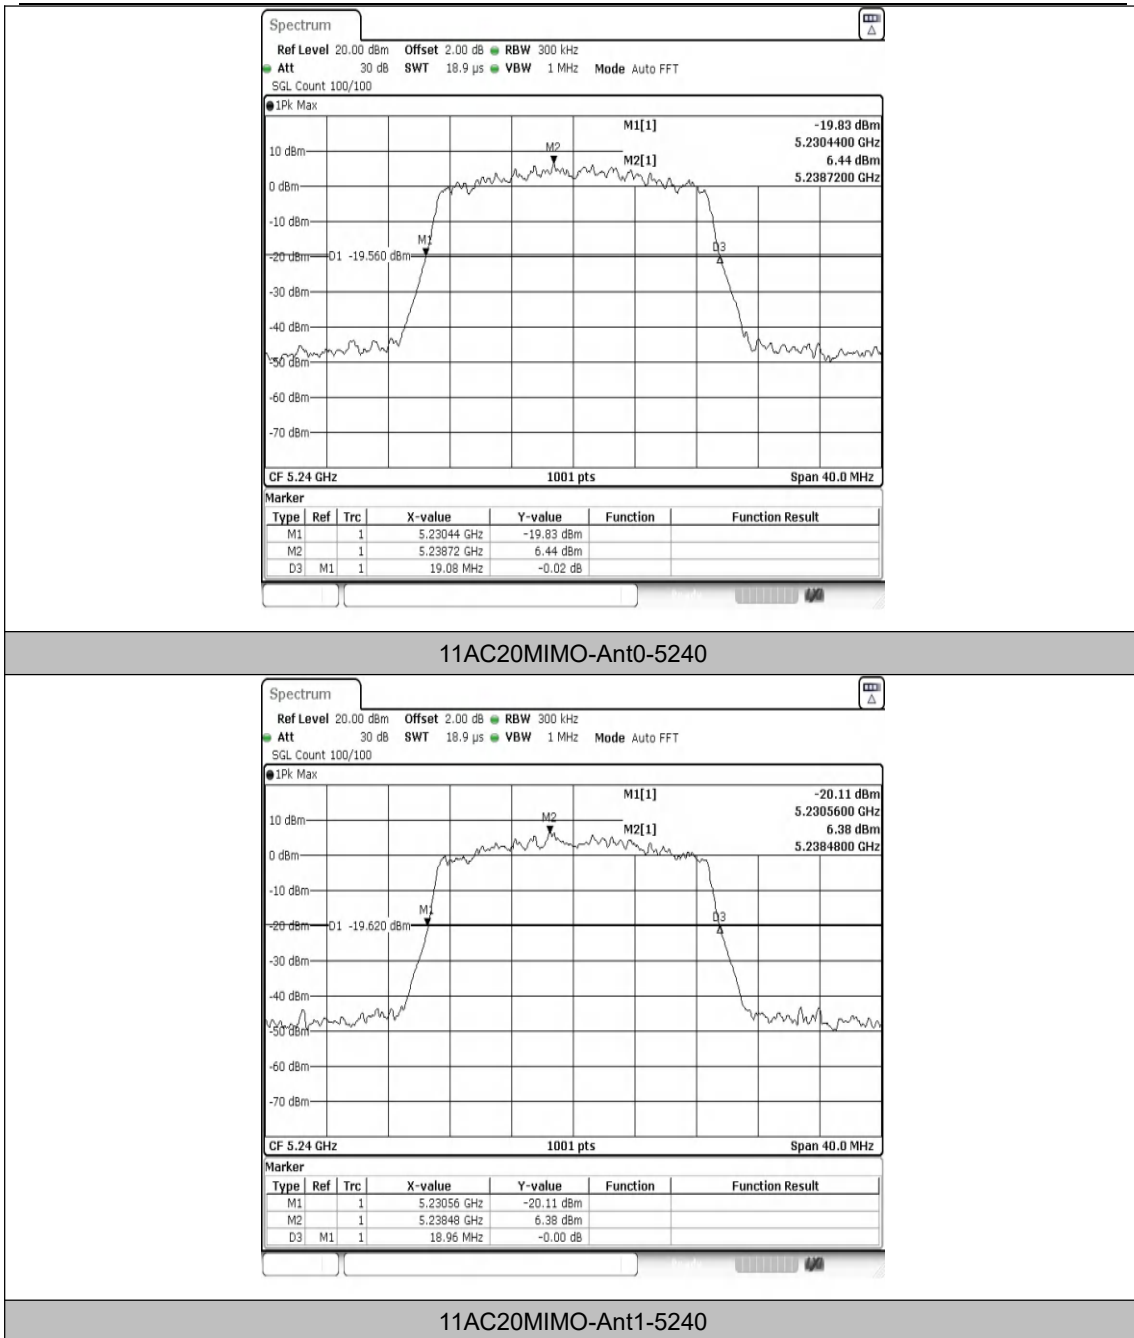

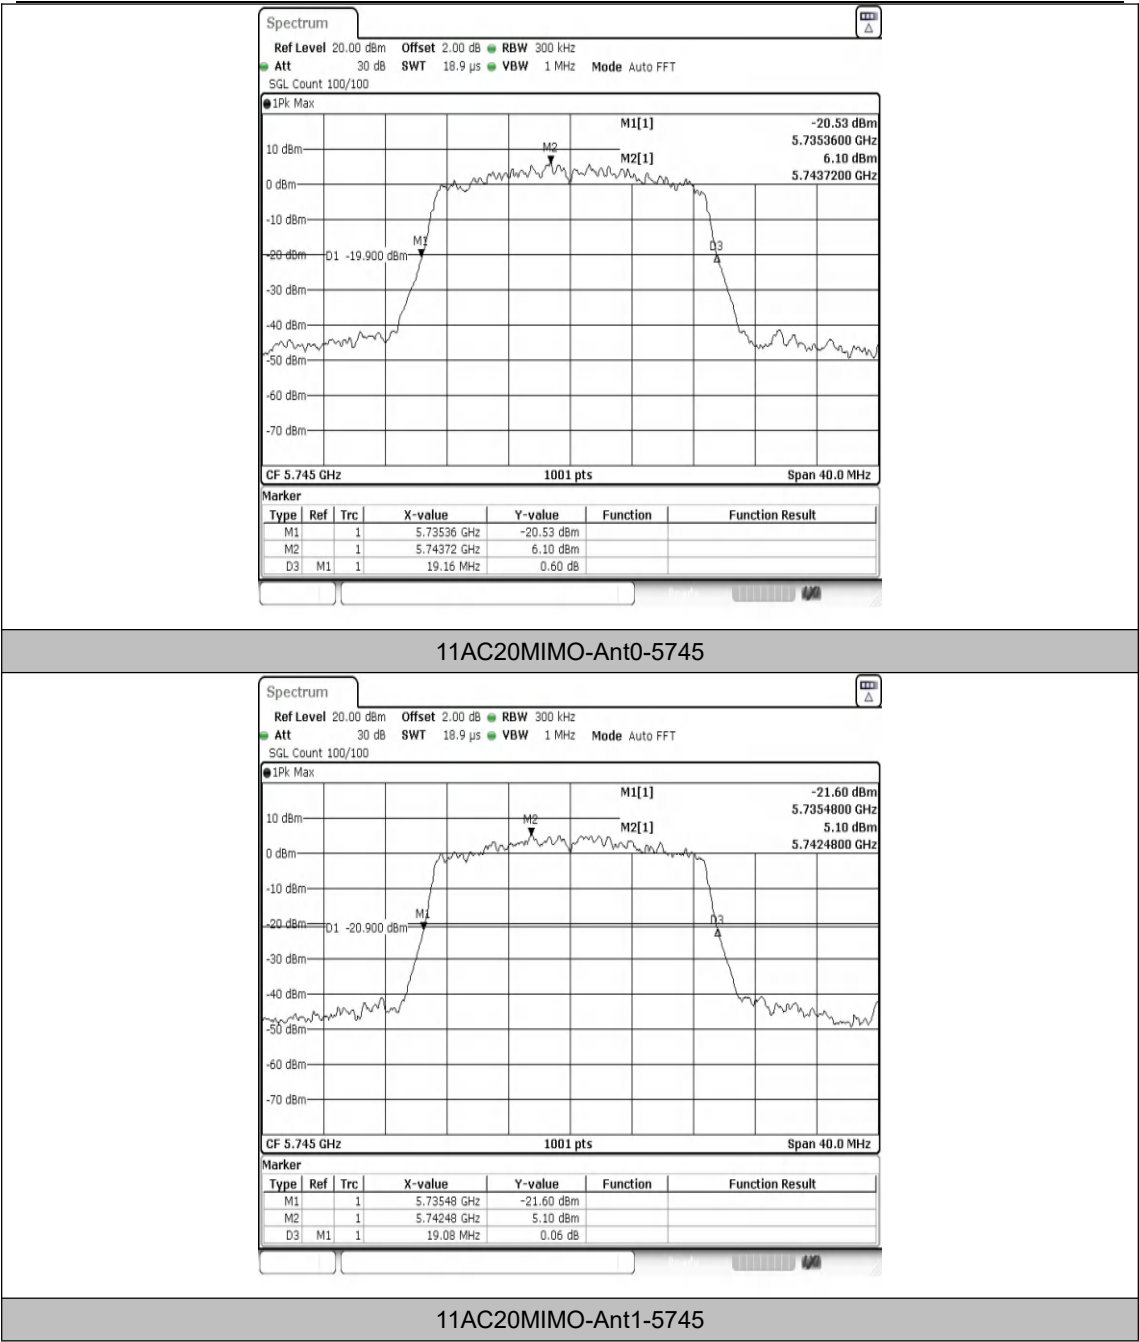

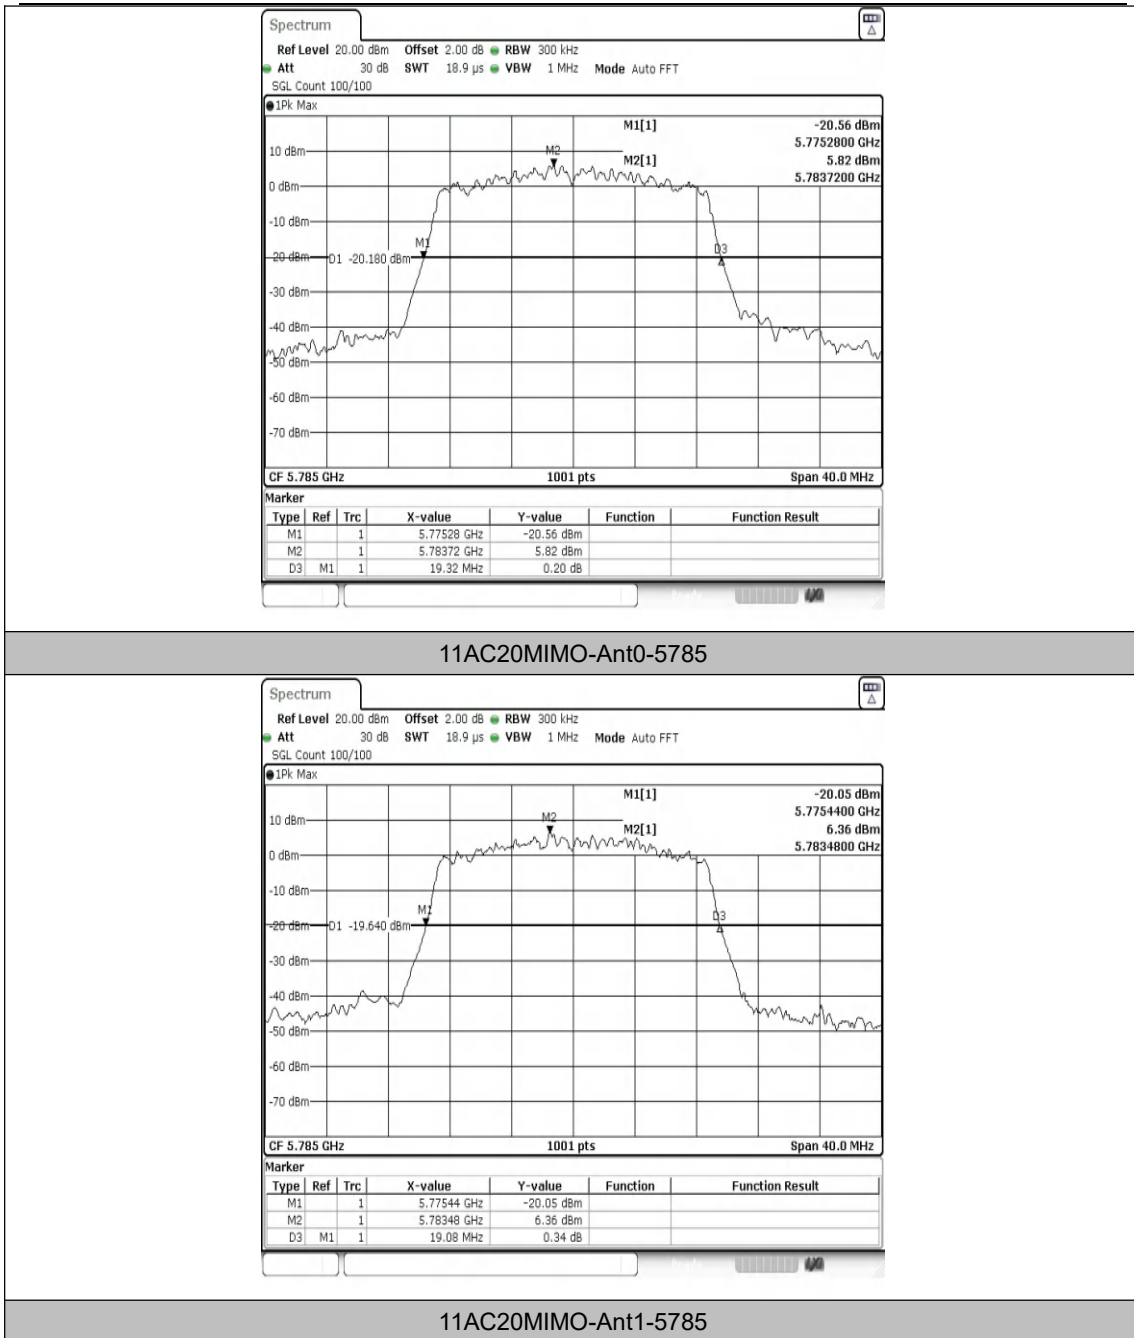


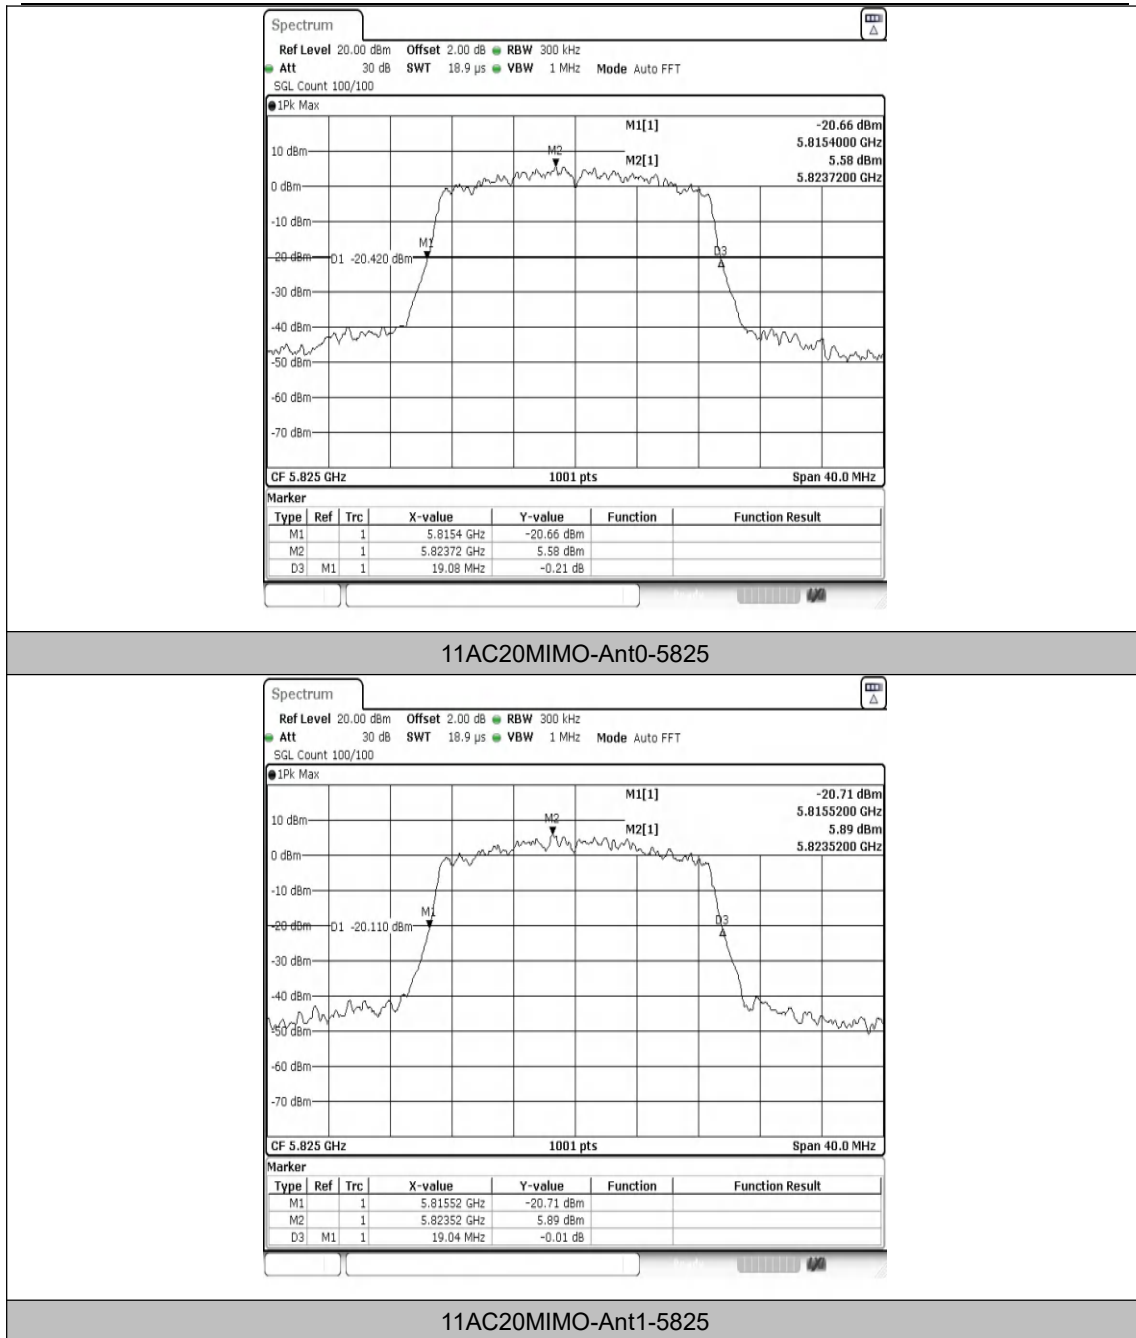



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

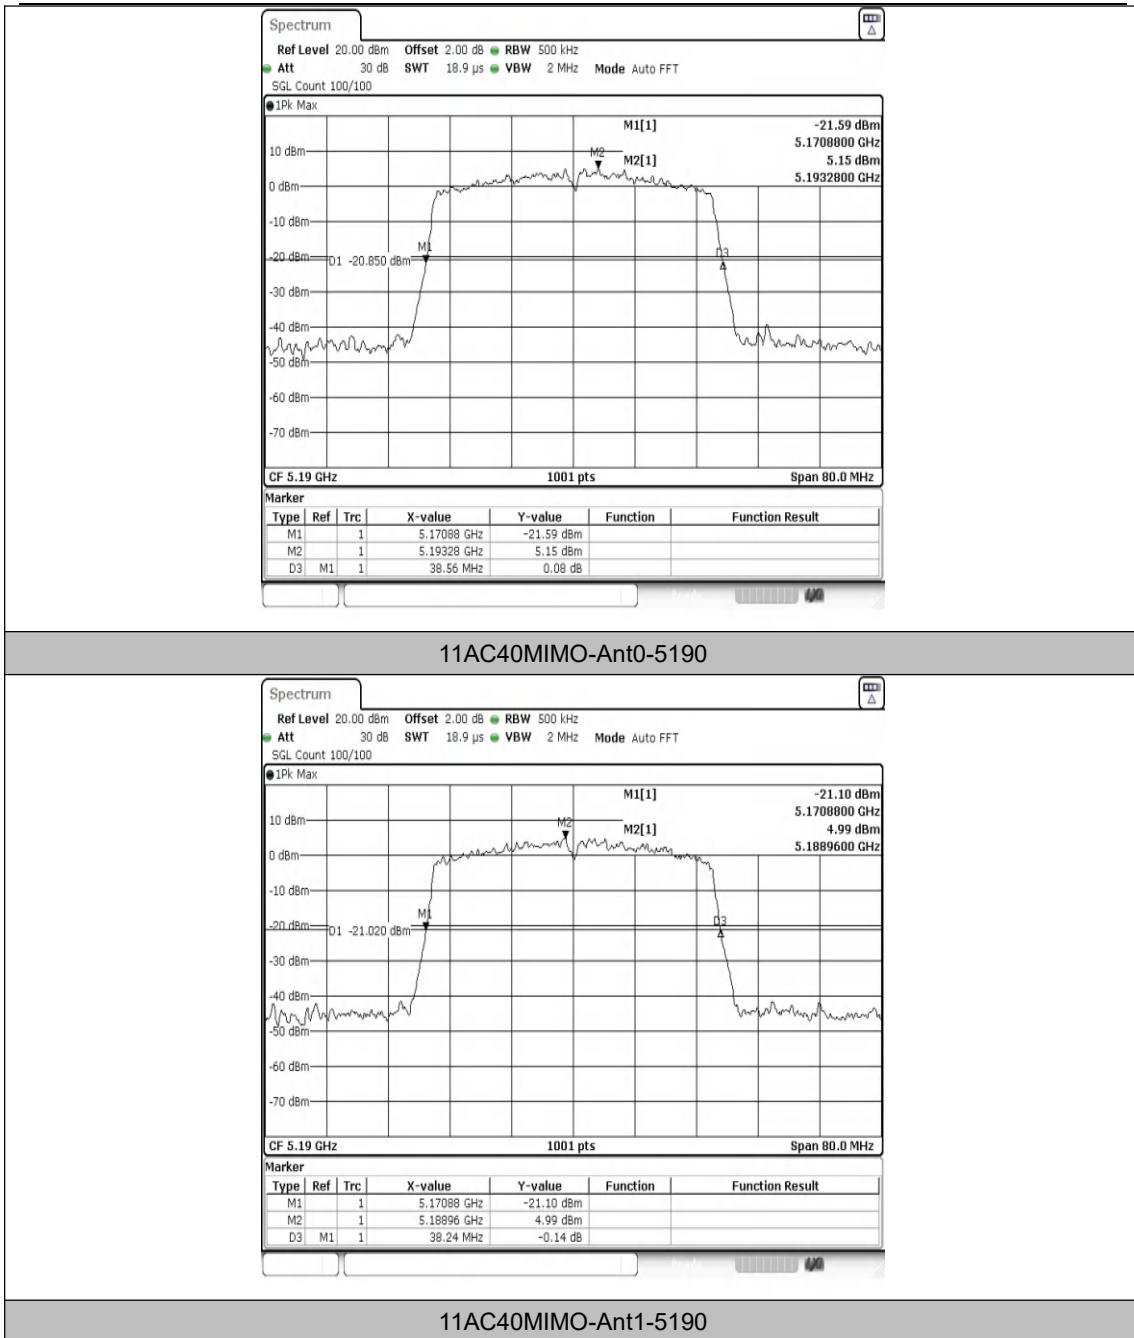


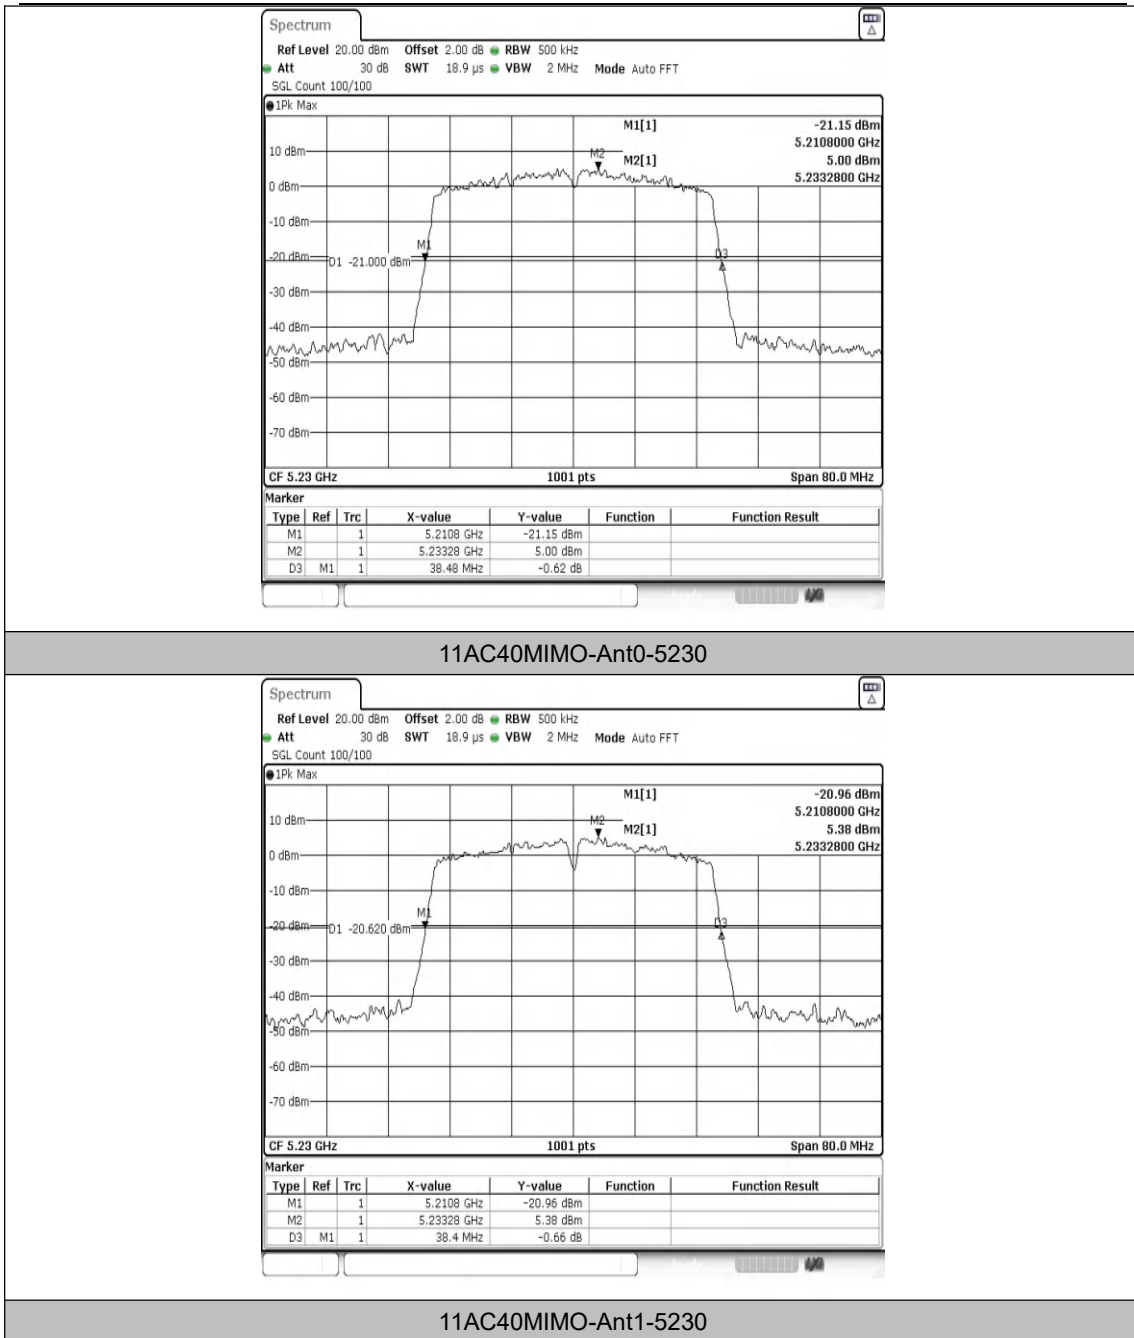


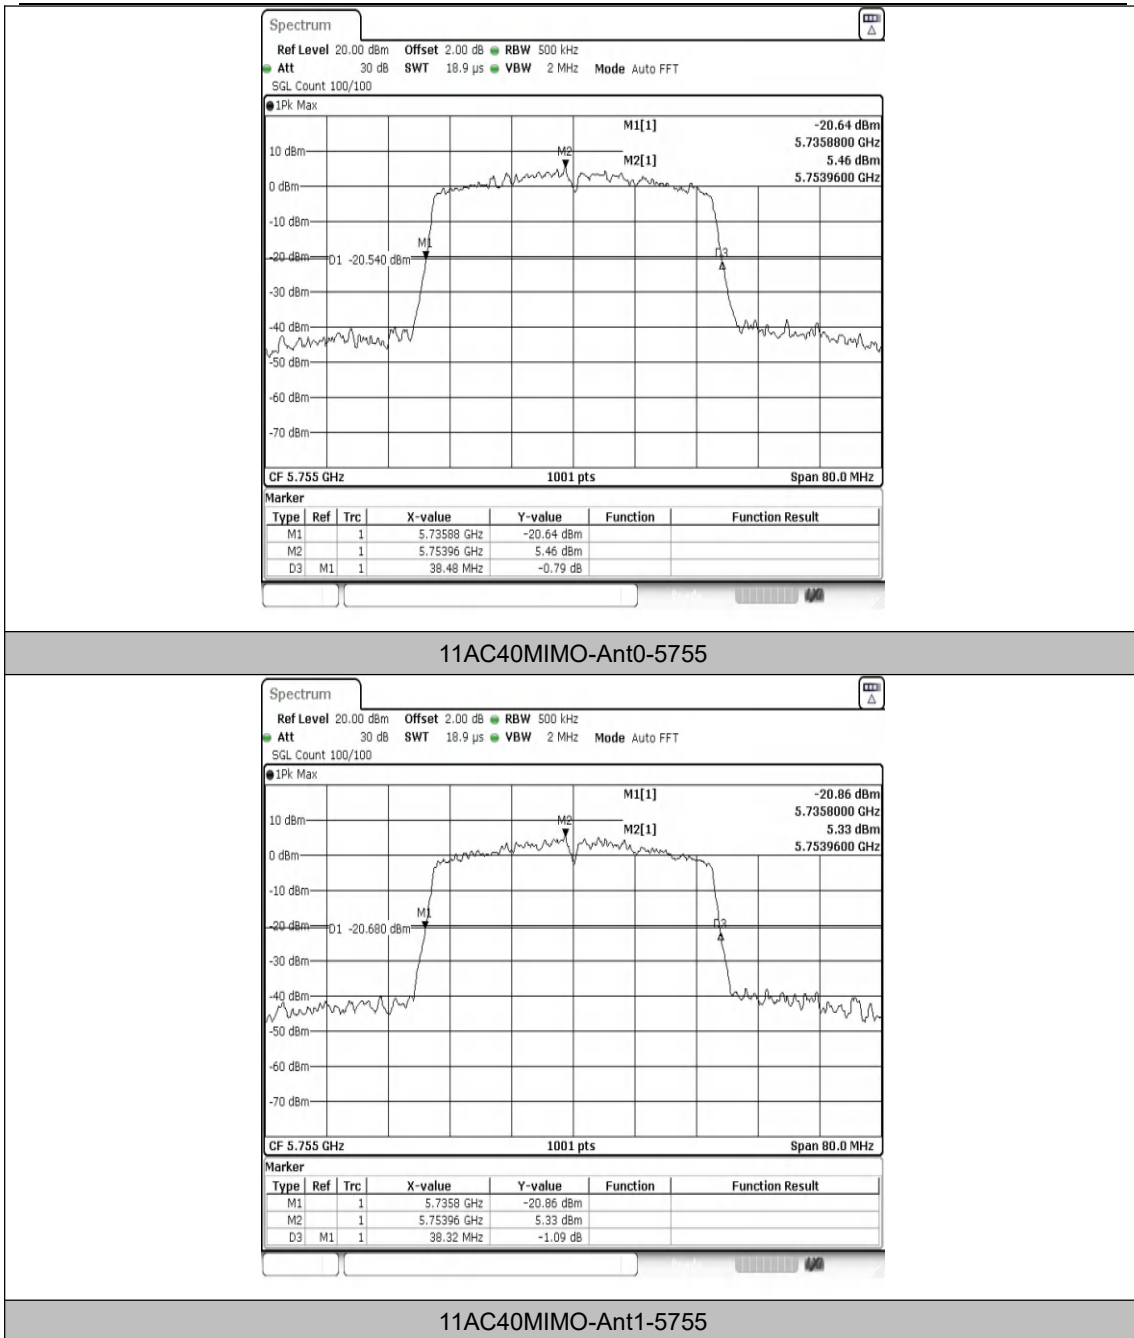


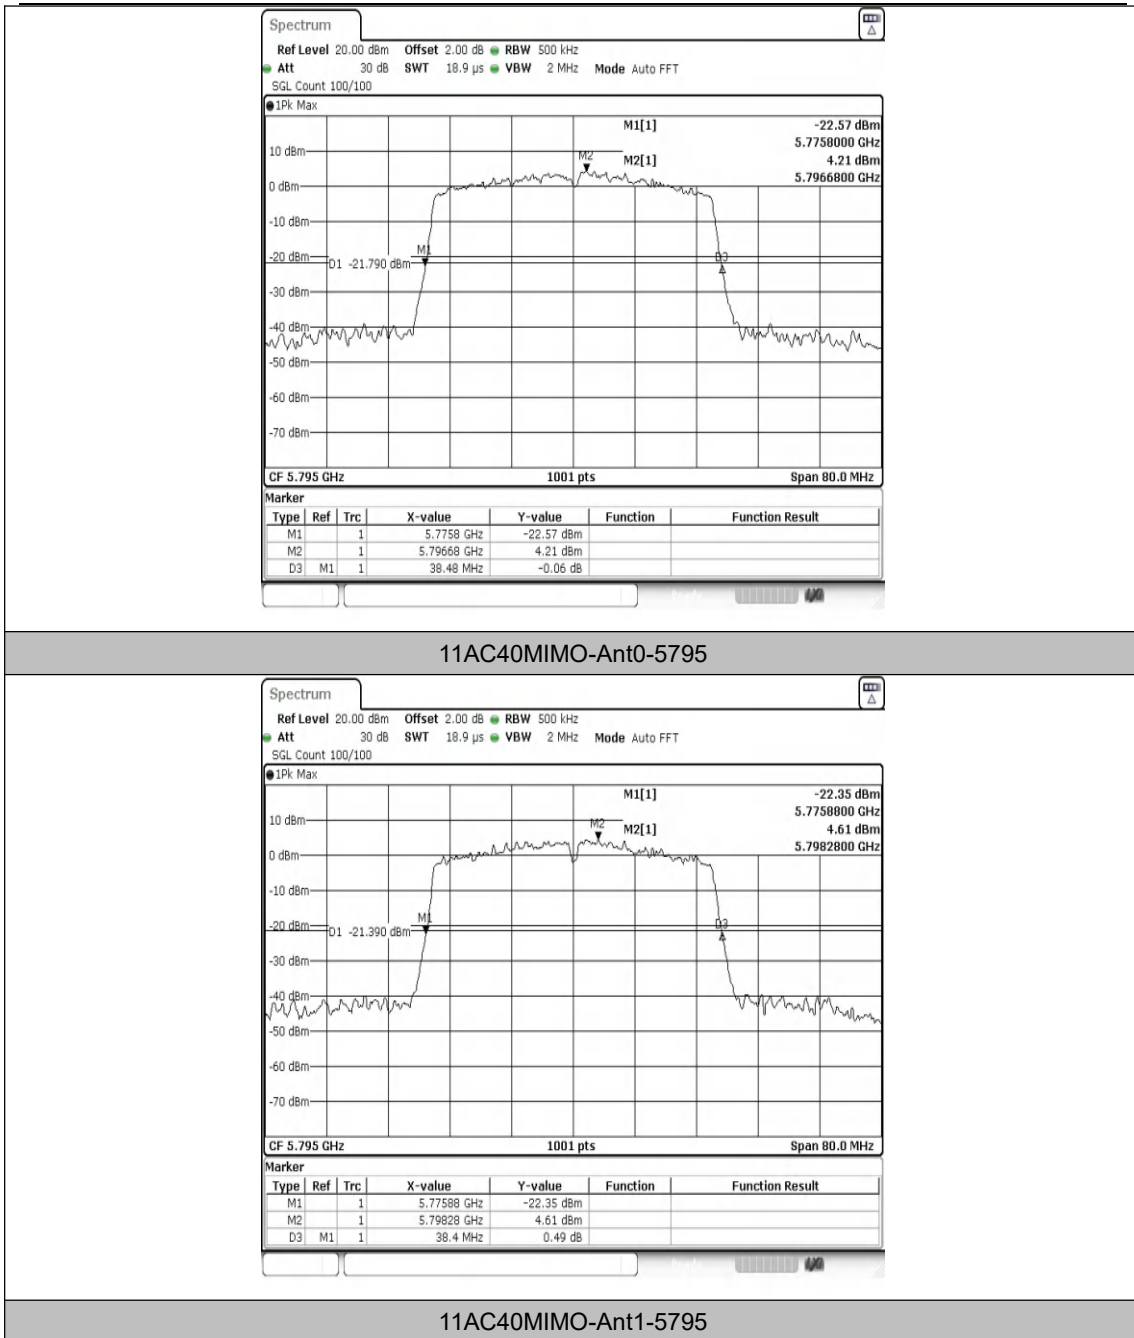


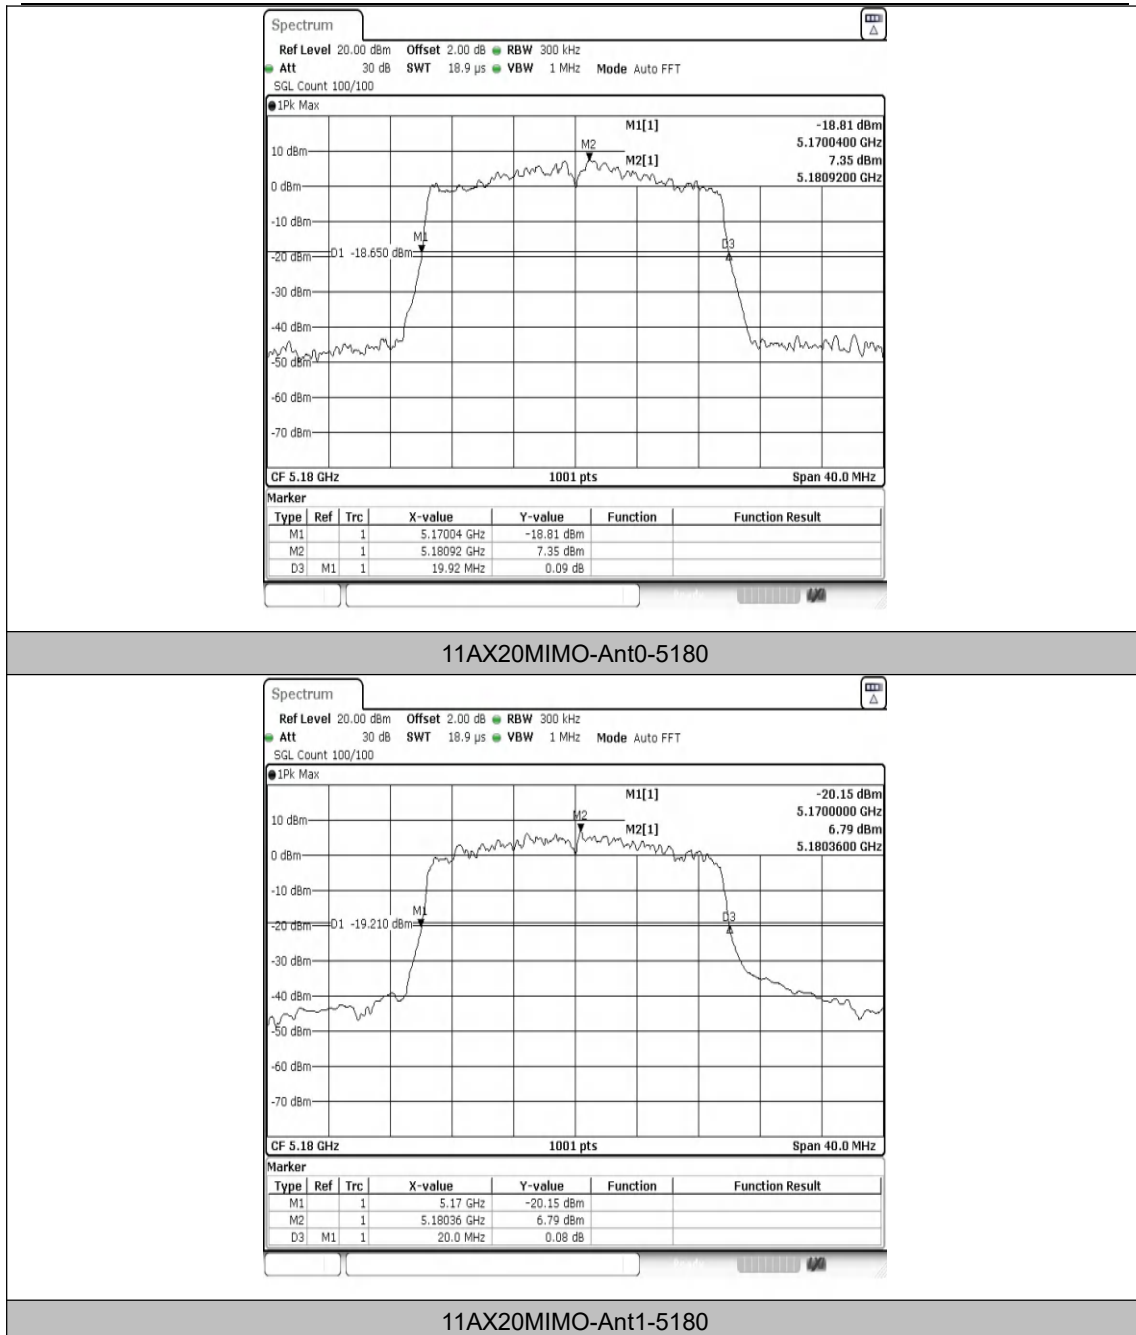

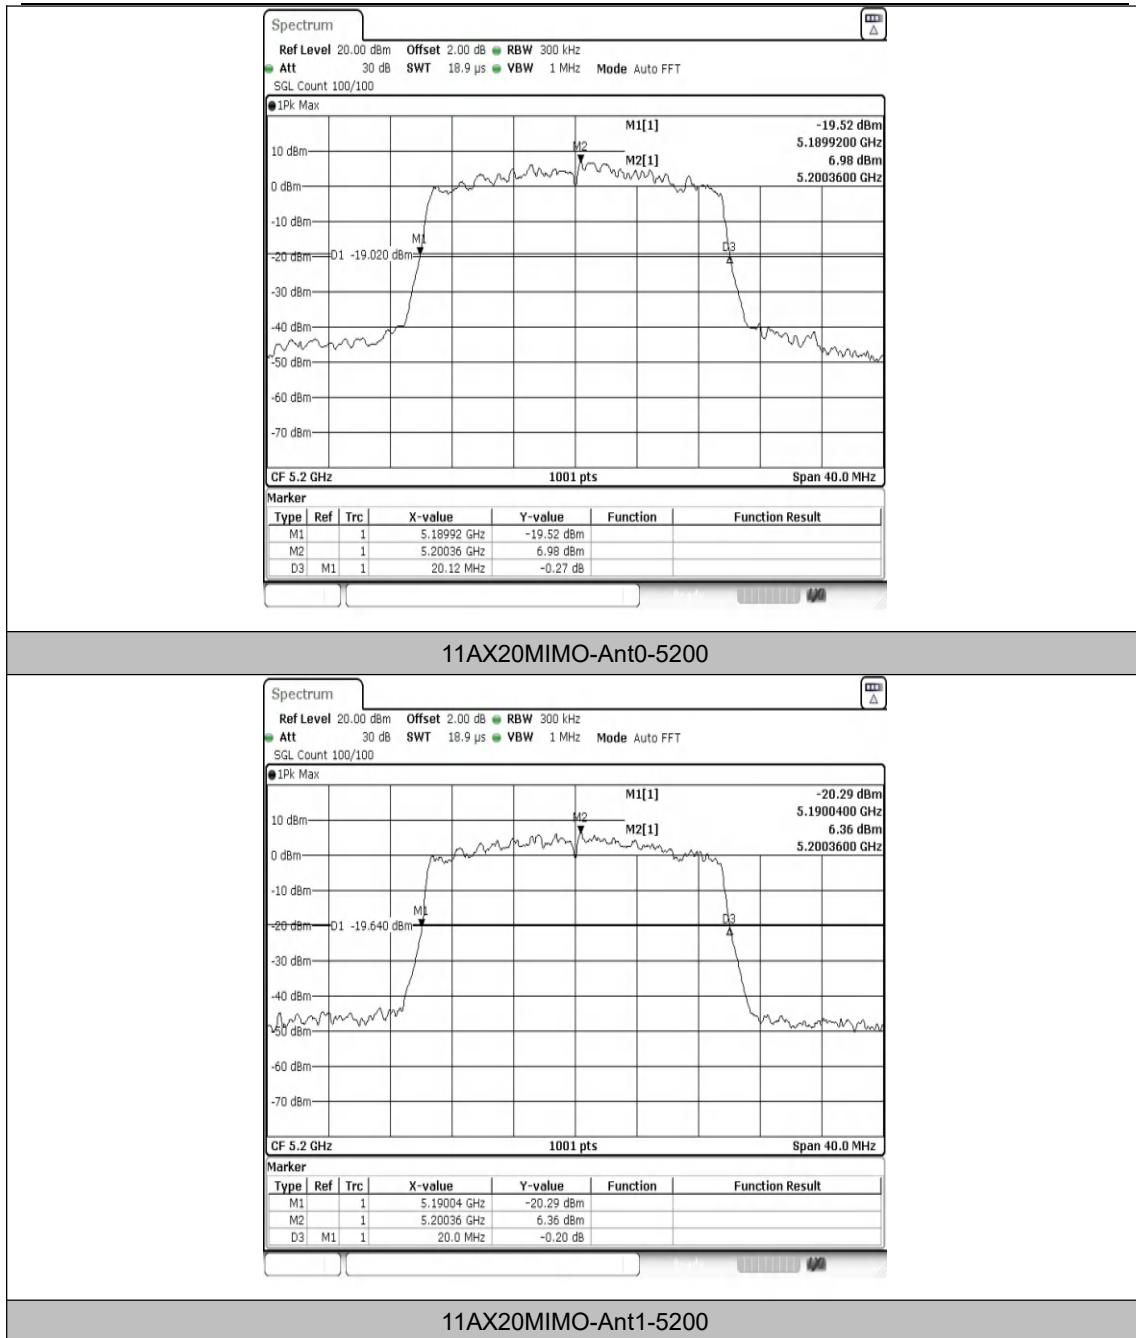

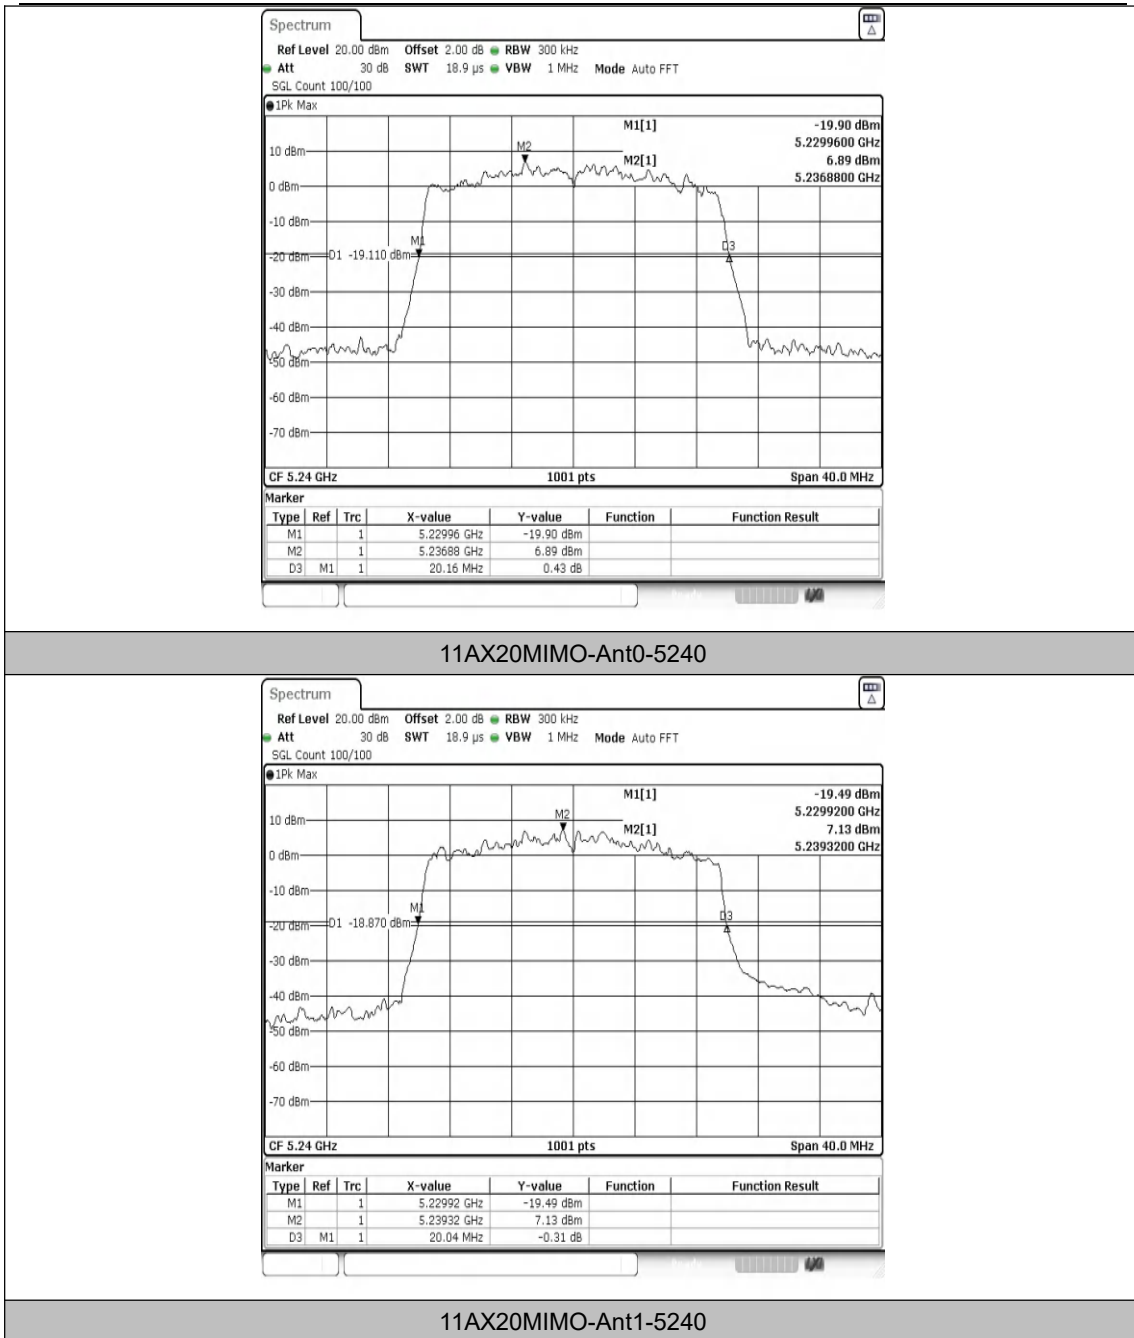

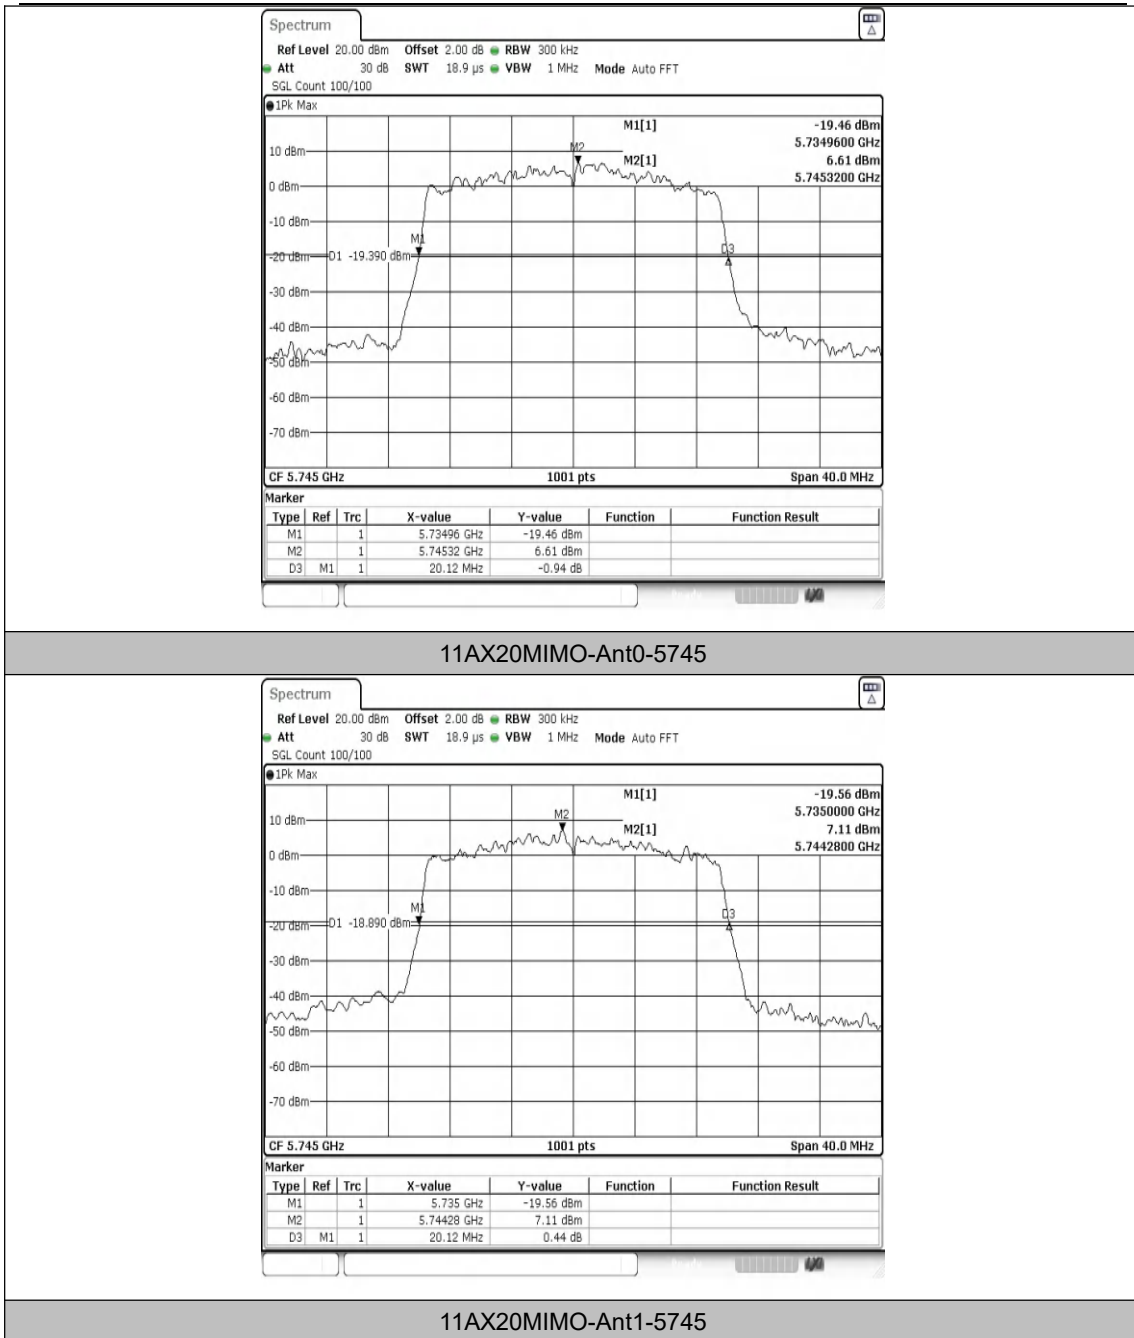


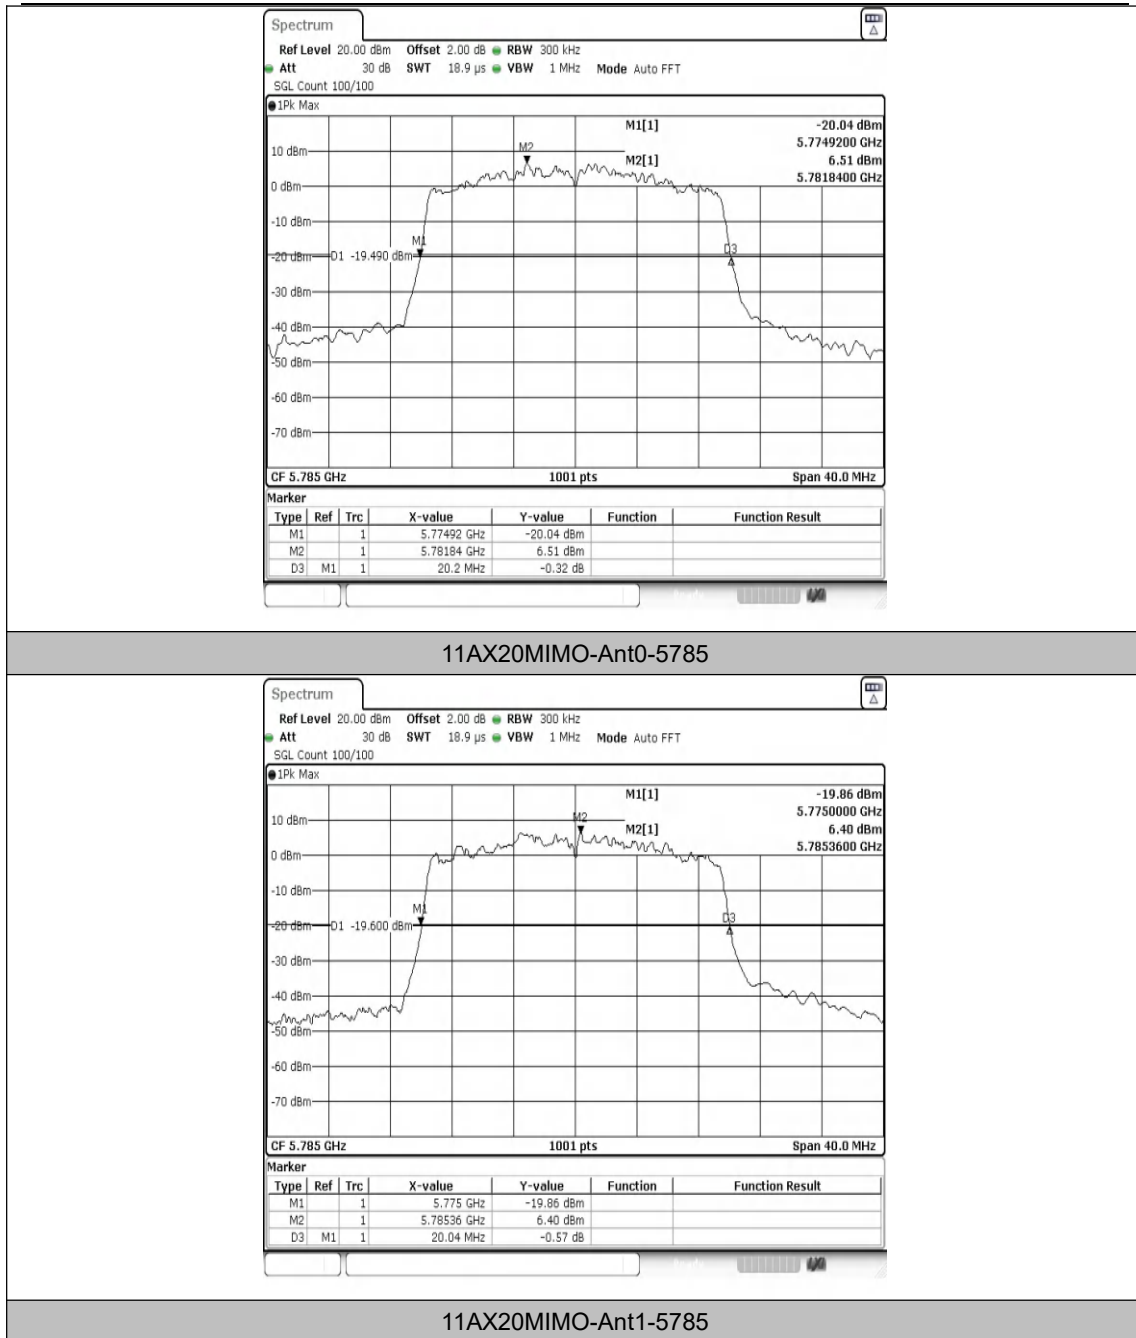



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

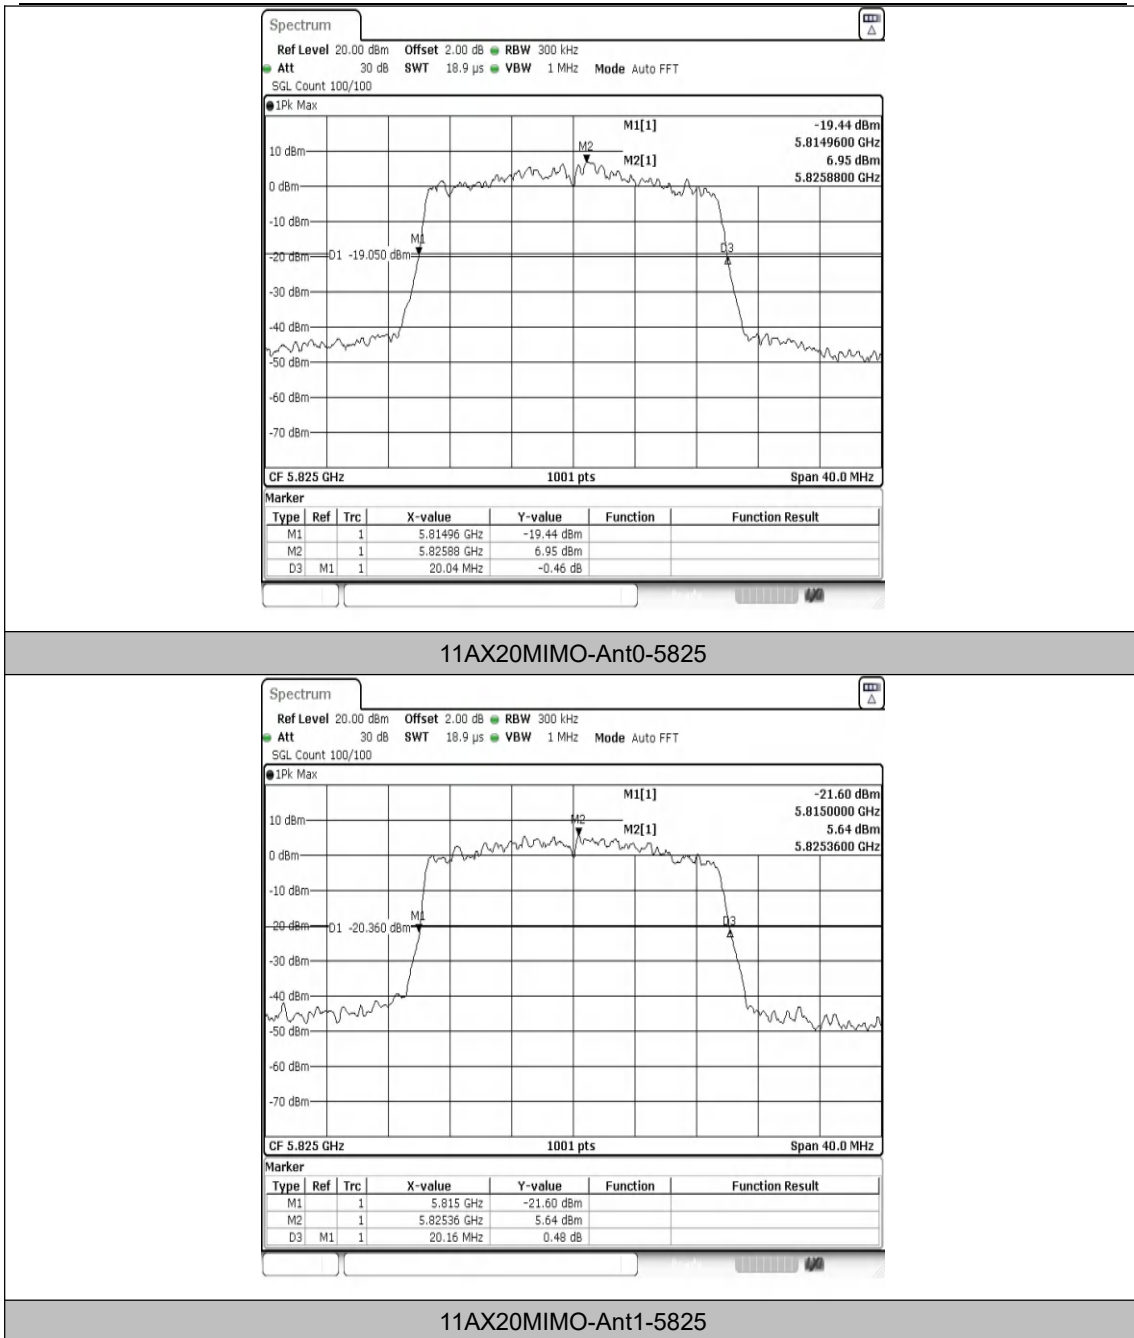

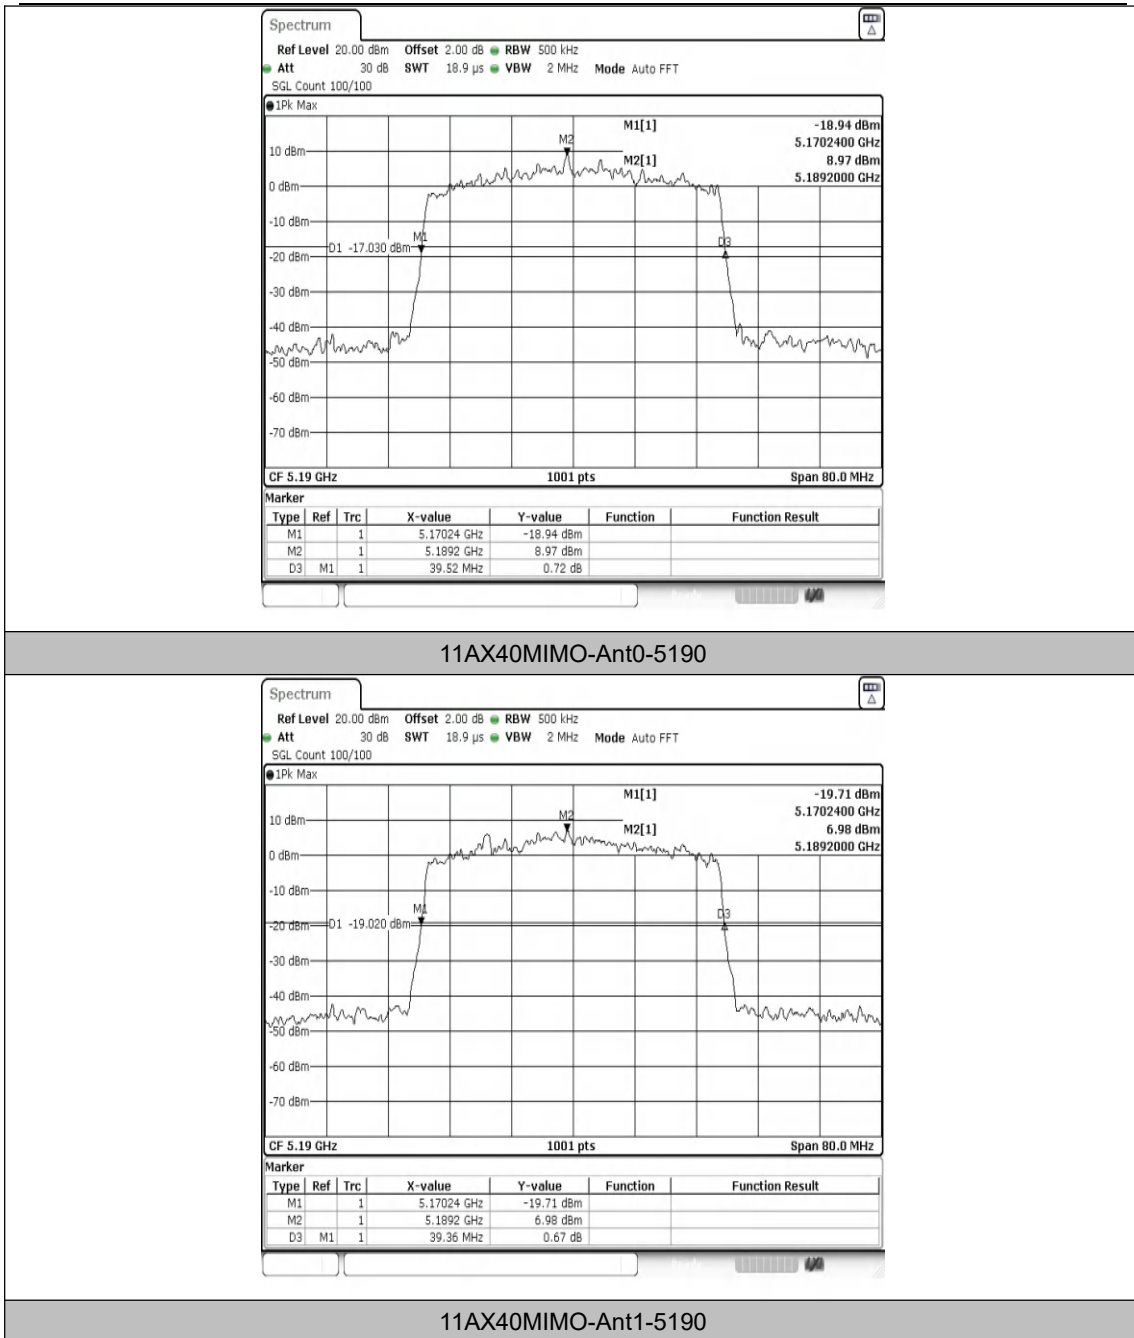

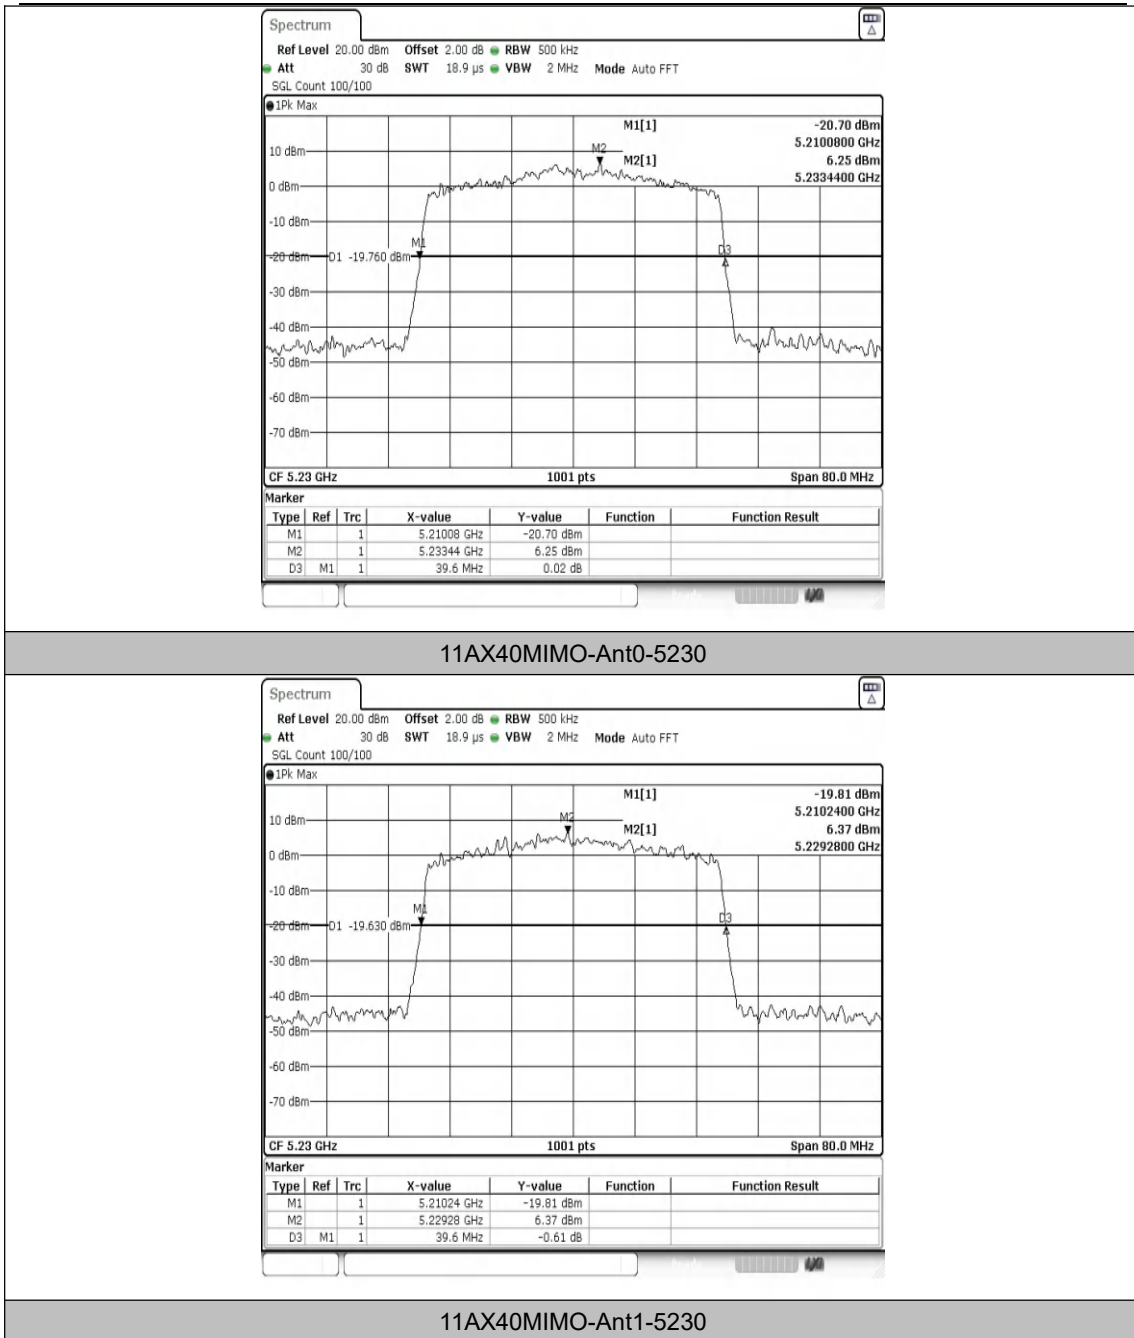

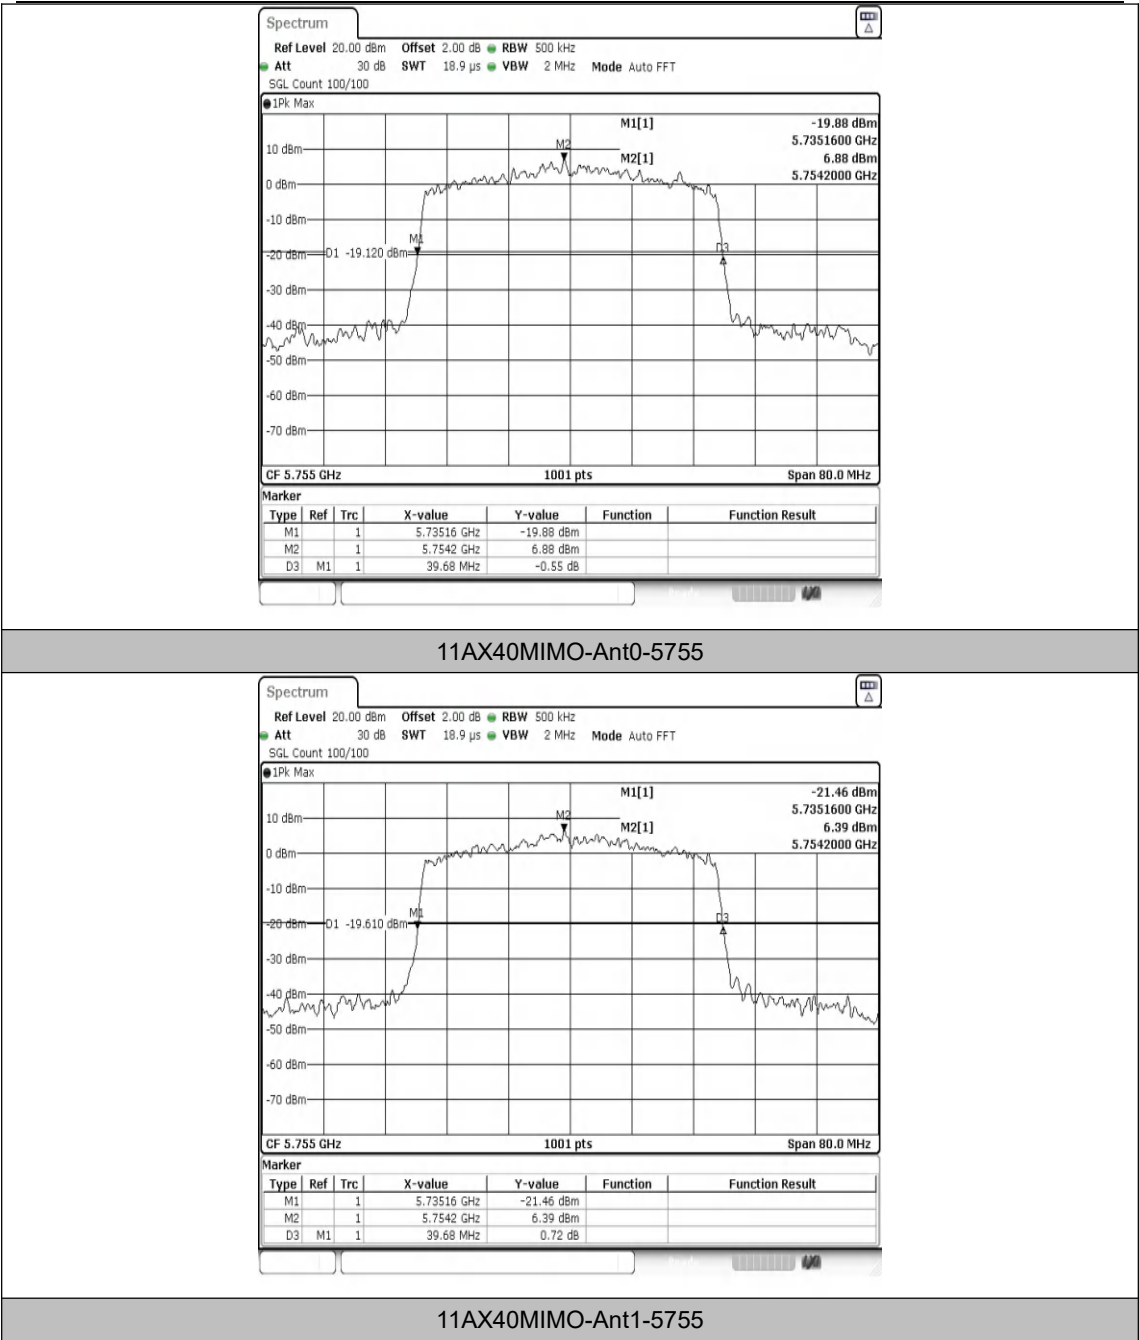

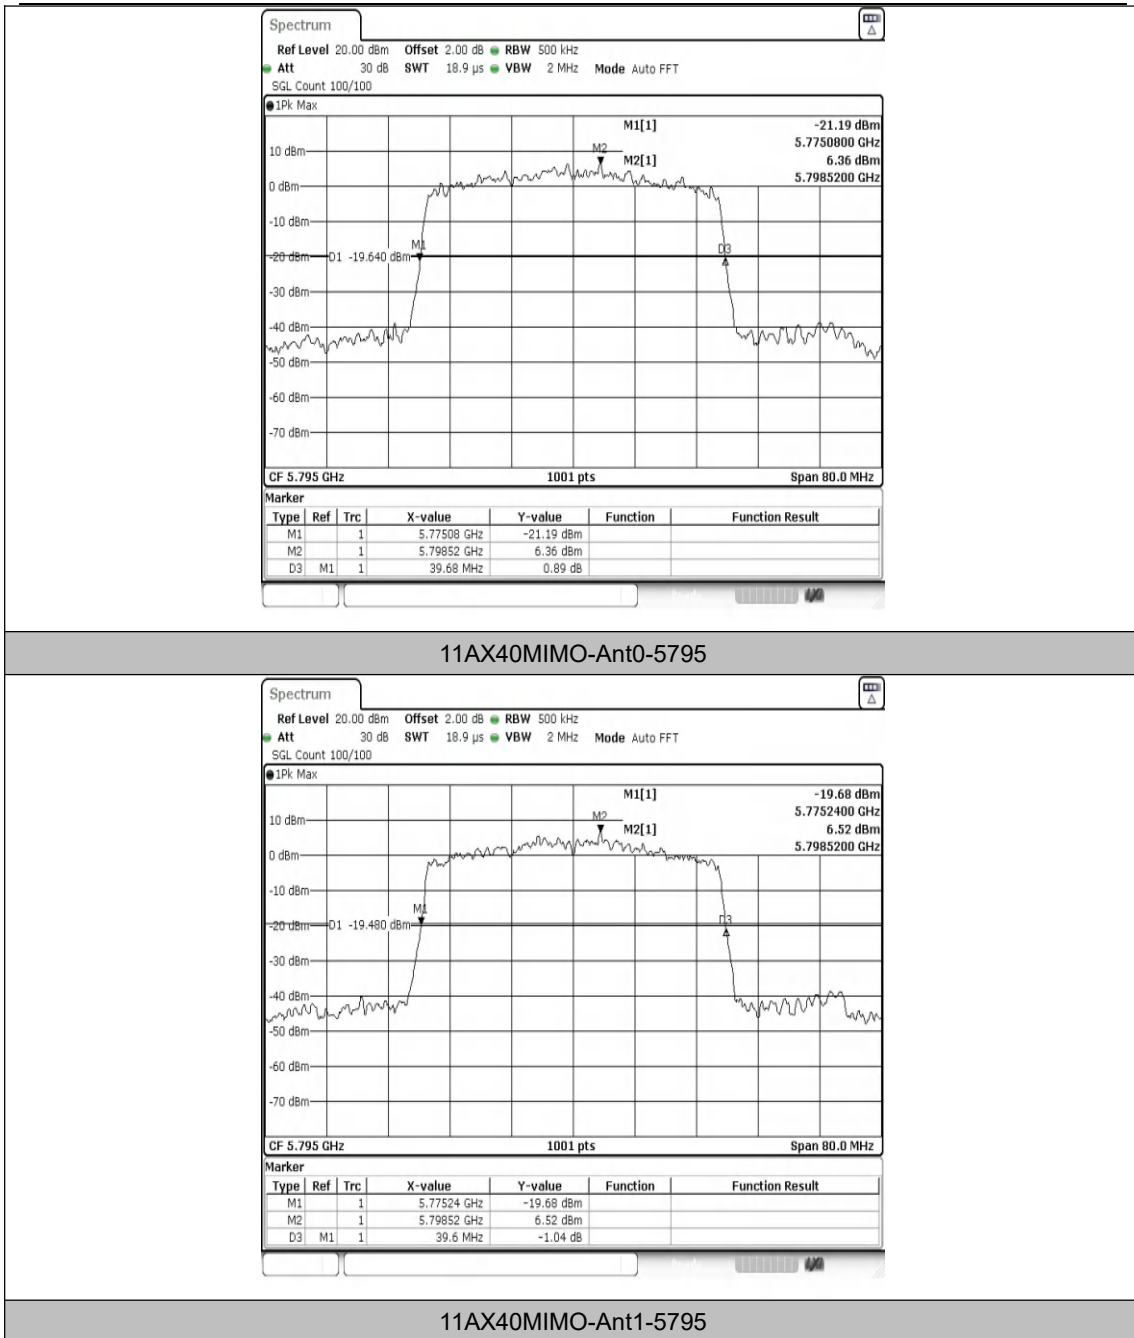

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant0	5180	16.264	5171.8881	5188.1518	---	---
11A	Ant1	5180	16.264	5171.8881	5188.1518	---	---
11A	Ant0	5200	16.264	5191.8881	5208.1518	---	---
11A	Ant1	5200	16.224	5191.9281	5208.1518	---	---
11A	Ant0	5240	16.224	5231.8881	5248.1119	---	---
11A	Ant1	5240	16.304	5231.8482	5248.1518	---	---
11A	Ant0	5745	16.224	5736.8482	5753.0719	---	---
11A	Ant1	5745	16.224	5736.8881	5753.1119	---	---
11A	Ant0	5785	16.184	5776.8881	5793.0719	---	---
11A	Ant1	5785	16.224	5776.8881	5793.1119	---	---
11A	Ant0	5825	16.224	5816.8881	5833.1119	---	---
11A	Ant1	5825	16.184	5816.8881	5833.0719	---	---
11N20MIMO	Ant0	5180	17.343	5171.3287	5188.6713	---	---
11N20MIMO	Ant1	5180	17.343	5171.3287	5188.6713	---	---
11N20MIMO	Ant0	5200	17.303	5191.3287	5208.6314	---	---
11N20MIMO	Ant1	5200	17.303	5191.3686	5208.6713	---	---
11N20MIMO	Ant0	5240	17.343	5231.3287	5248.6713	---	---
11N20MIMO	Ant1	5240	17.303	5231.3287	5248.6314	---	---
11N20MIMO	Ant0	5745	17.303	5736.3287	5753.6314	---	---
11N20MIMO	Ant1	5745	17.343	5736.3287	5753.6713	---	---
11N20MIMO	Ant0	5785	17.303	5776.3287	5793.6314	---	---
11N20MIMO	Ant1	5785	17.303	5776.3287	5793.6314	---	---
11N20MIMO	Ant0	5825	17.303	5816.3287	5833.6314	---	---
11N20MIMO	Ant1	5825	17.303	5816.3287	5833.6314	---	---
11N40MIMO	Ant0	5190	35.724	5172.0979	5207.8222	---	---
11N40MIMO	Ant1	5190	35.724	5172.0979	5207.8222	---	---
11N40MIMO	Ant0	5230	35.644	5212.0979	5247.7423	---	---
11N40MIMO	Ant1	5230	35.804	5212.0180	5247.8222	---	---
11N40MIMO	Ant0	5755	35.724	5737.0180	5772.7423	---	---
11N40MIMO	Ant1	5755	35.724	5737.0180	5772.7423	---	---
11N40MIMO	Ant0	5795	35.724	5777.0180	5812.7423	---	---
11N40MIMO	Ant1	5795	35.724	5777.0180	5812.7423	---	---
11AC20MIMO	Ant0	5180	17.383	5171.2887	5188.6713	---	---
11AC20MIMO	Ant1	5180	17.383	5171.2887	5188.6713	---	---
11AC20MIMO	Ant0	5200	17.343	5191.2887	5208.6314	---	---
11AC20MIMO	Ant1	5200	17.383	5191.2887	5208.6713	---	---
11AC20MIMO	Ant0	5240	17.383	5231.2887	5248.6713	---	---


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC20MIMO	Ant1	5240	17.343	5231.2887	5248.6314	---	---
11AC20MIMO	Ant0	5745	17.423	5736.2887	5753.7113	---	---
11AC20MIMO	Ant1	5745	17.423	5736.2887	5753.7113	---	---
11AC20MIMO	Ant0	5785	17.383	5776.2488	5793.6314	---	---
11AC20MIMO	Ant1	5785	17.383	5776.2887	5793.6713	---	---
11AC20MIMO	Ant0	5825	17.423	5816.2488	5833.6713	---	---
11AC20MIMO	Ant1	5825	17.463	5816.2488	5833.7113	---	---
11AC40MIMO	Ant0	5190	35.485	5172.2577	5207.7423	---	---
11AC40MIMO	Ant1	5190	35.485	5172.2577	5207.7423	---	---
11AC40MIMO	Ant0	5230	35.405	5212.2577	5247.6623	---	---
11AC40MIMO	Ant1	5230	35.564	5212.2577	5247.8222	---	---
11AC40MIMO	Ant0	5755	35.485	5737.2577	5772.7423	---	---
11AC40MIMO	Ant1	5755	35.564	5737.1778	5772.7423	---	---
11AC40MIMO	Ant0	5795	35.485	5777.1778	5812.6623	---	---
11AC40MIMO	Ant1	5795	35.485	5777.1778	5812.6623	---	---
11AX20MIMO	Ant0	5180	18.661	5170.6094	5189.2707	---	---
11AX20MIMO	Ant1	5180	18.621	5170.6094	5189.2308	---	---
11AX20MIMO	Ant0	5200	18.661	5190.6094	5209.2707	---	---
11AX20MIMO	Ant1	5200	18.581	5190.6893	5209.2707	---	---
11AX20MIMO	Ant0	5240	18.621	5230.6094	5249.2308	---	---
11AX20MIMO	Ant1	5240	18.661	5230.5694	5249.2308	---	---
11AX20MIMO	Ant0	5745	18.661	5735.6094	5754.2707	---	---
11AX20MIMO	Ant1	5745	18.621	5735.6094	5754.2308	---	---
11AX20MIMO	Ant0	5785	18.621	5775.6094	5794.2308	---	---
11AX20MIMO	Ant1	5785	18.621	5775.6094	5794.2308	---	---
11AX20MIMO	Ant0	5825	18.621	5815.6094	5834.2308	---	---
11AX20MIMO	Ant1	5825	18.661	5815.5694	5834.2308	---	---
11AX40MIMO	Ant0	5190	37.083	5171.5385	5208.6214	---	---
11AX40MIMO	Ant1	5190	37.003	5171.5385	5208.5415	---	---
11AX40MIMO	Ant0	5230	37.003	5211.5385	5248.5415	---	---
11AX40MIMO	Ant1	5230	36.923	5211.5385	5248.4615	---	---
11AX40MIMO	Ant0	5755	37.163	5736.4585	5773.6214	---	---
11AX40MIMO	Ant1	5755	37.163	5736.4585	5773.6214	---	---
11AX40MIMO	Ant0	5795	36.923	5776.5385	5813.4615	---	---
11AX40MIMO	Ant1	5795	37.003	5776.5385	5813.5415	---	---

Test Graphs

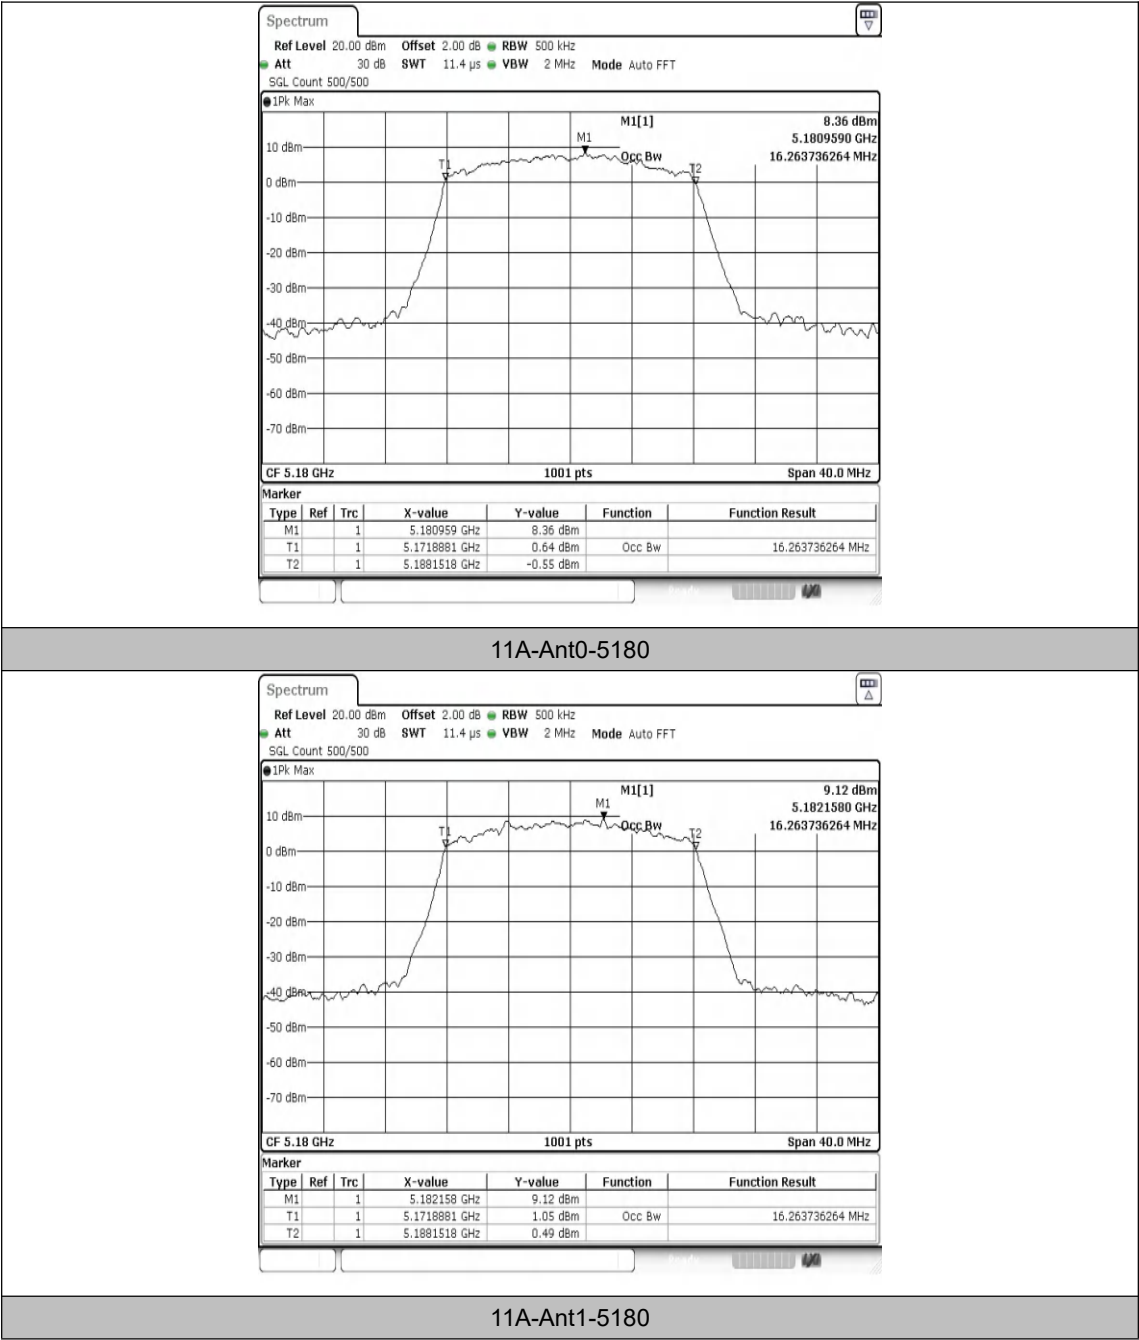

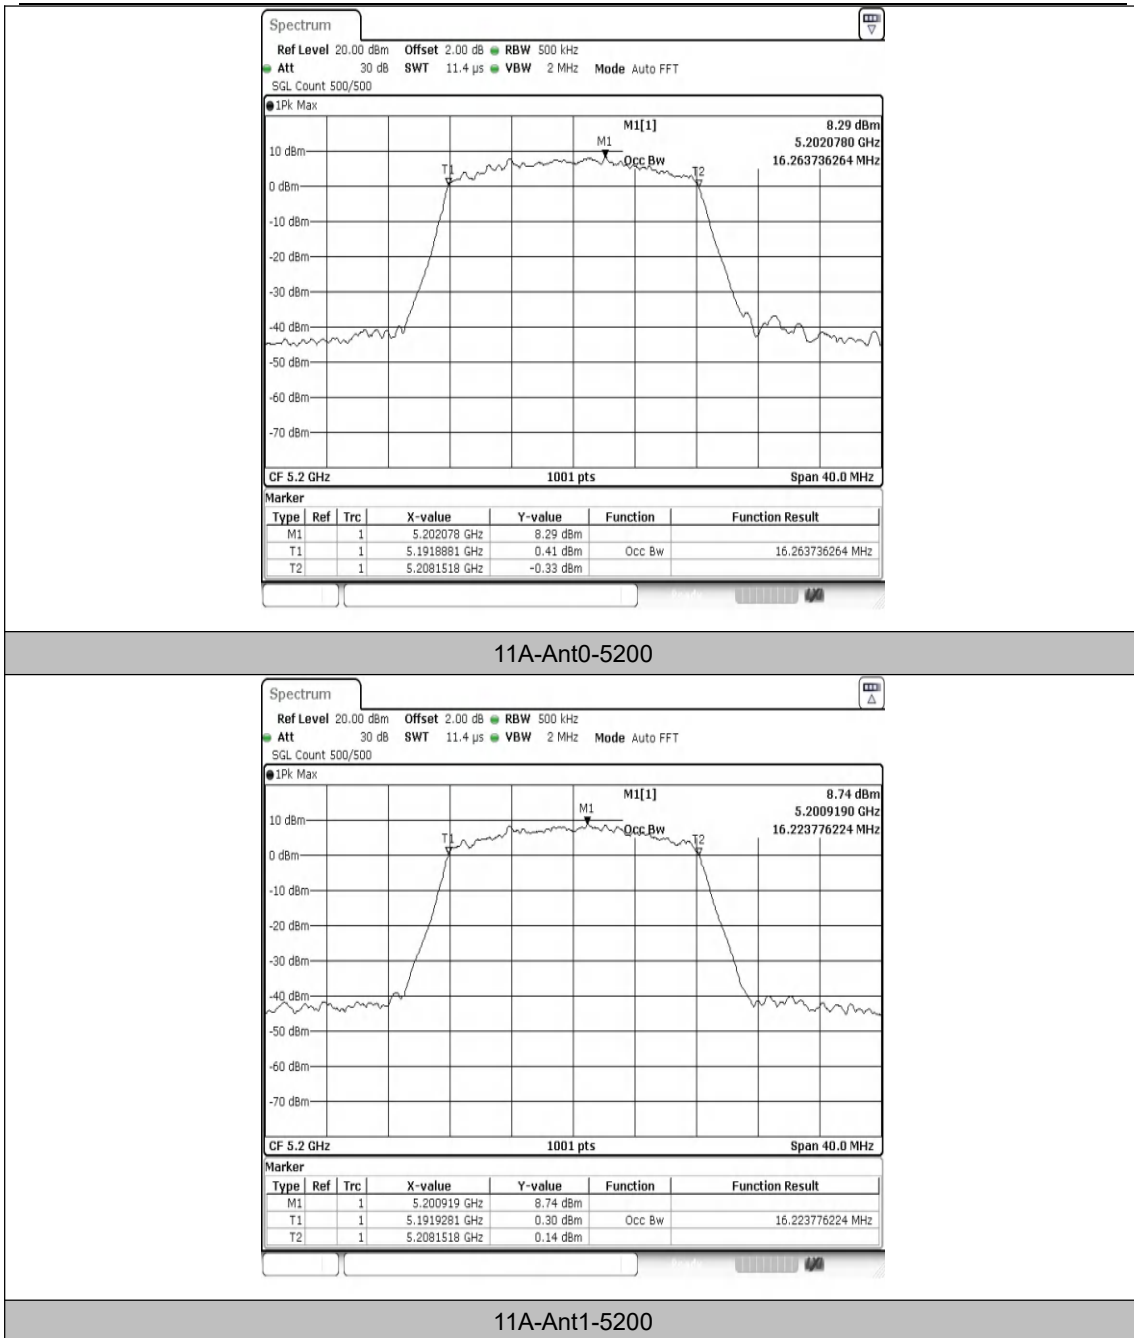


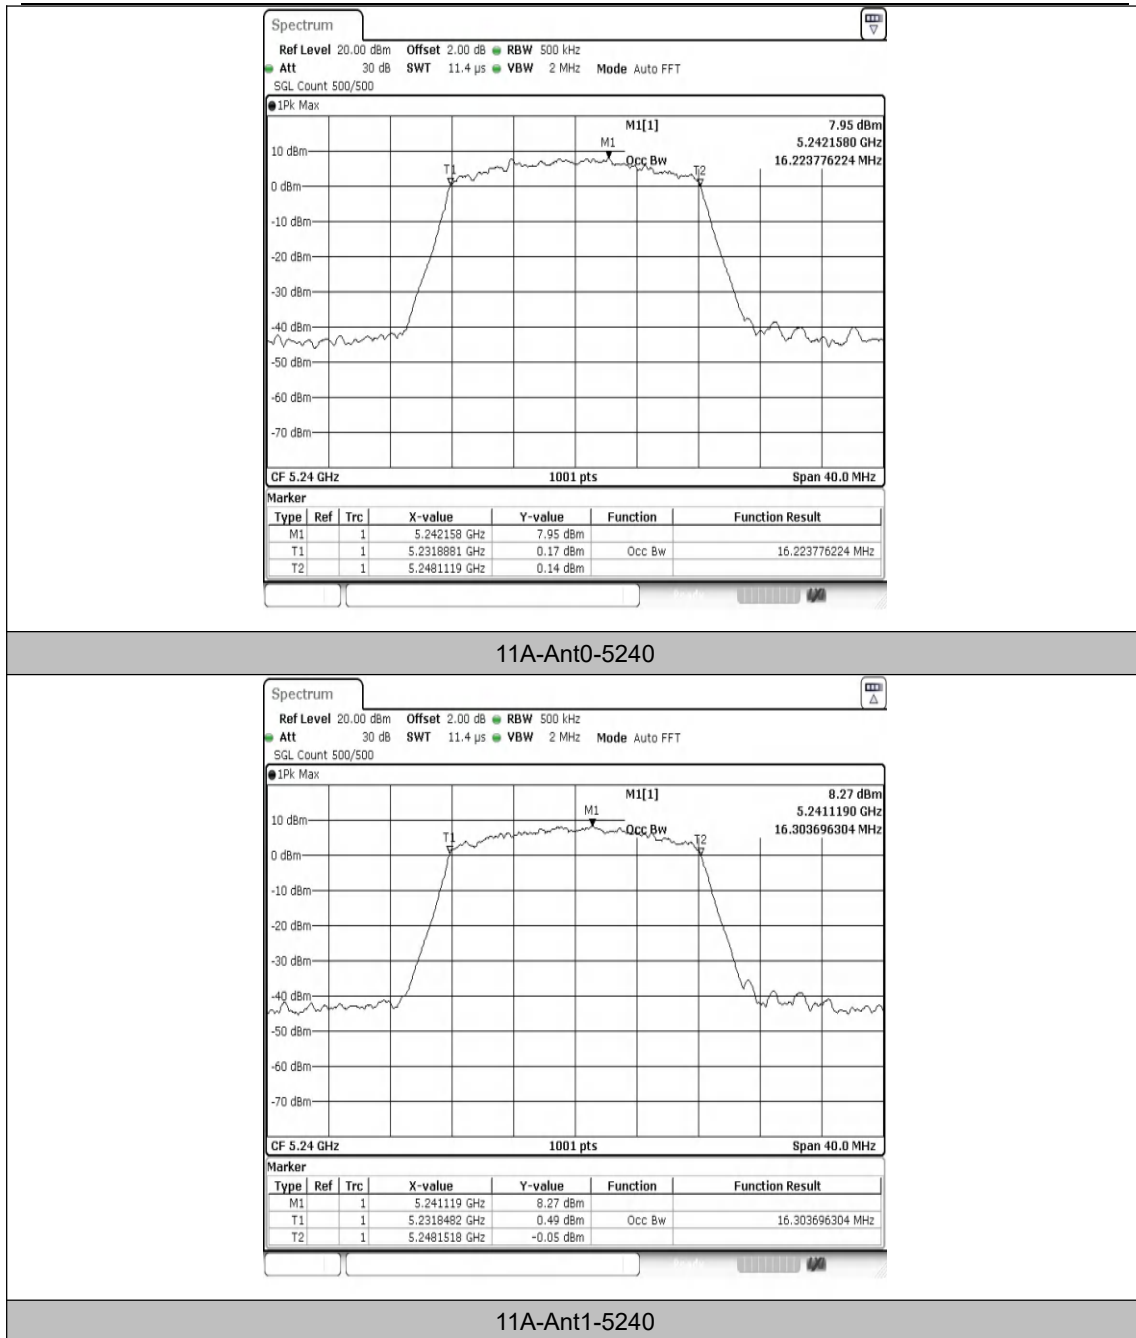



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

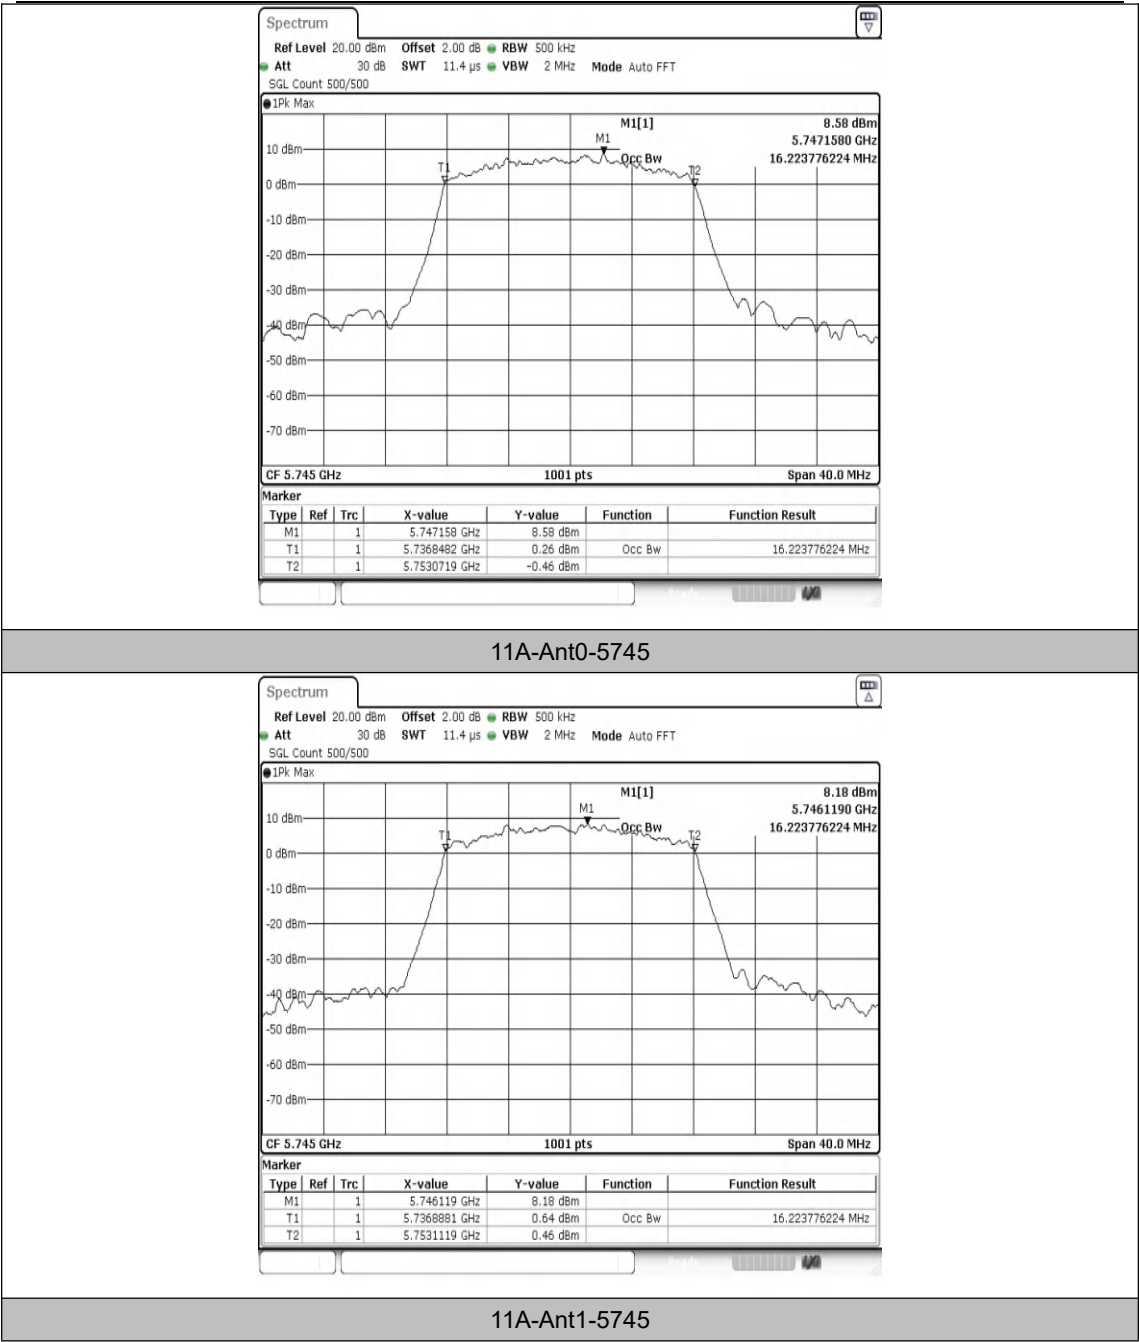

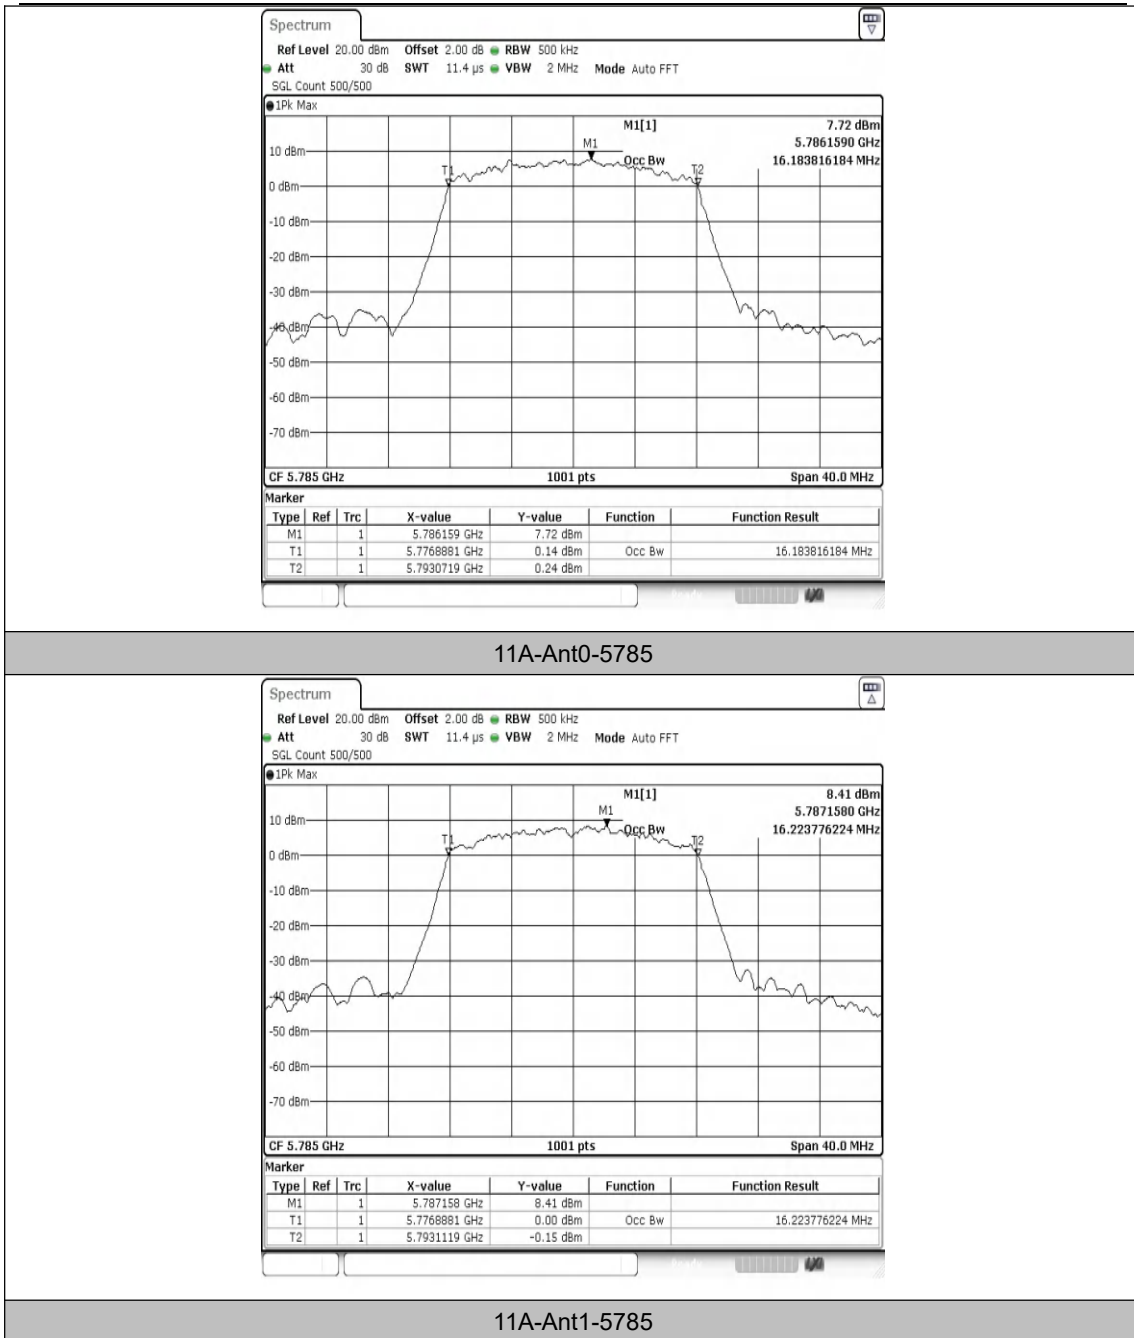


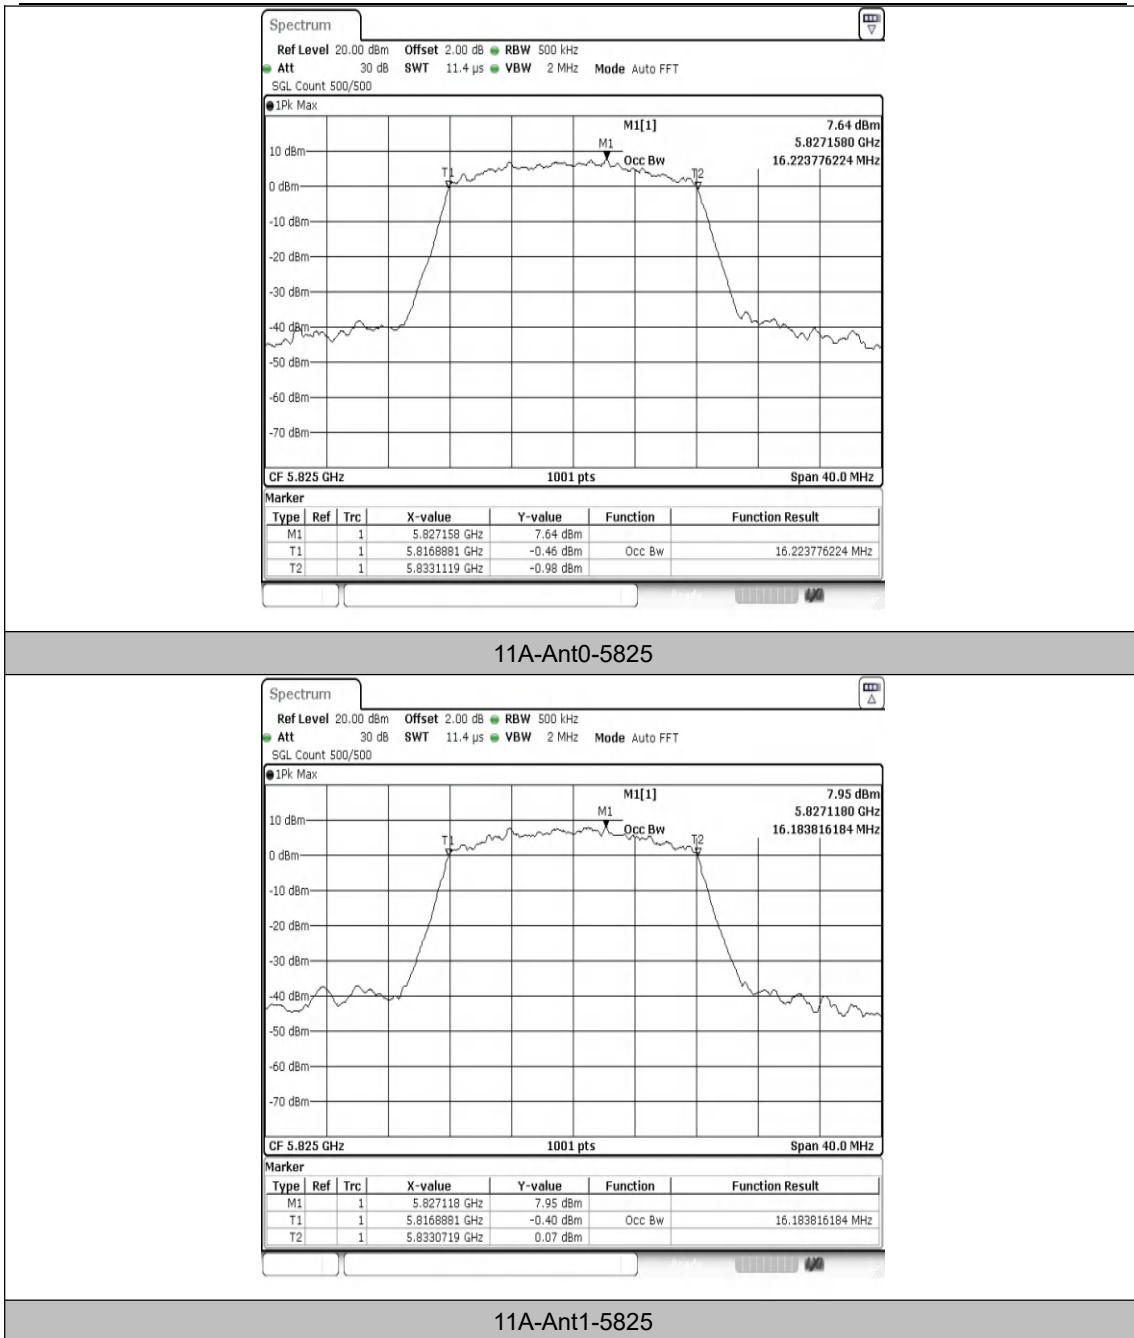

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

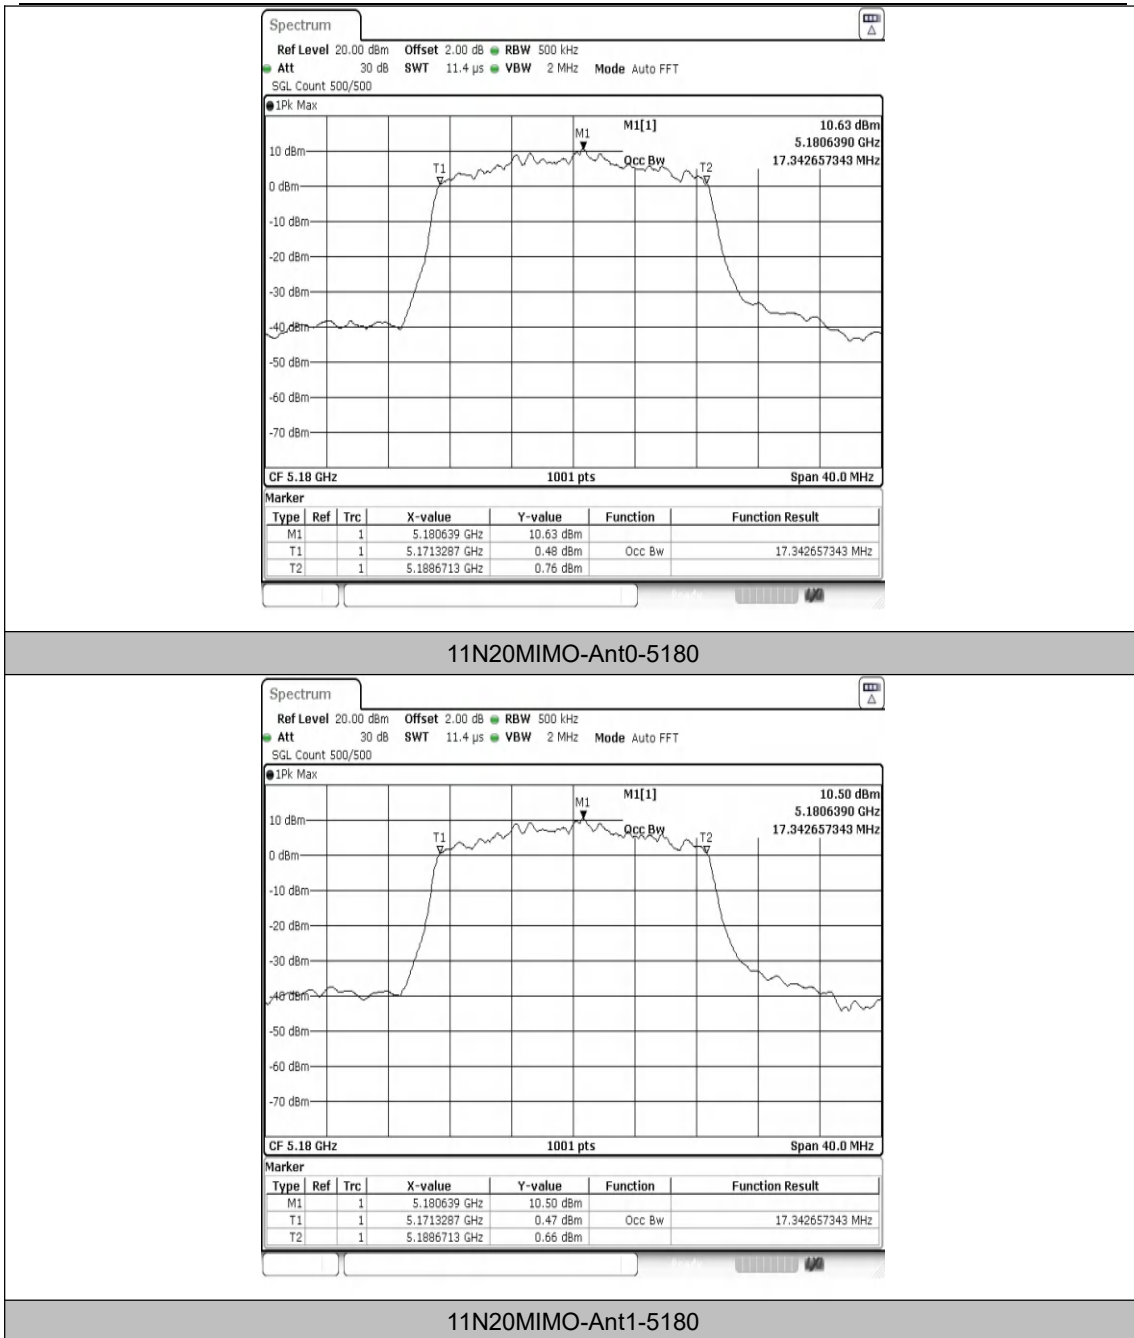

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

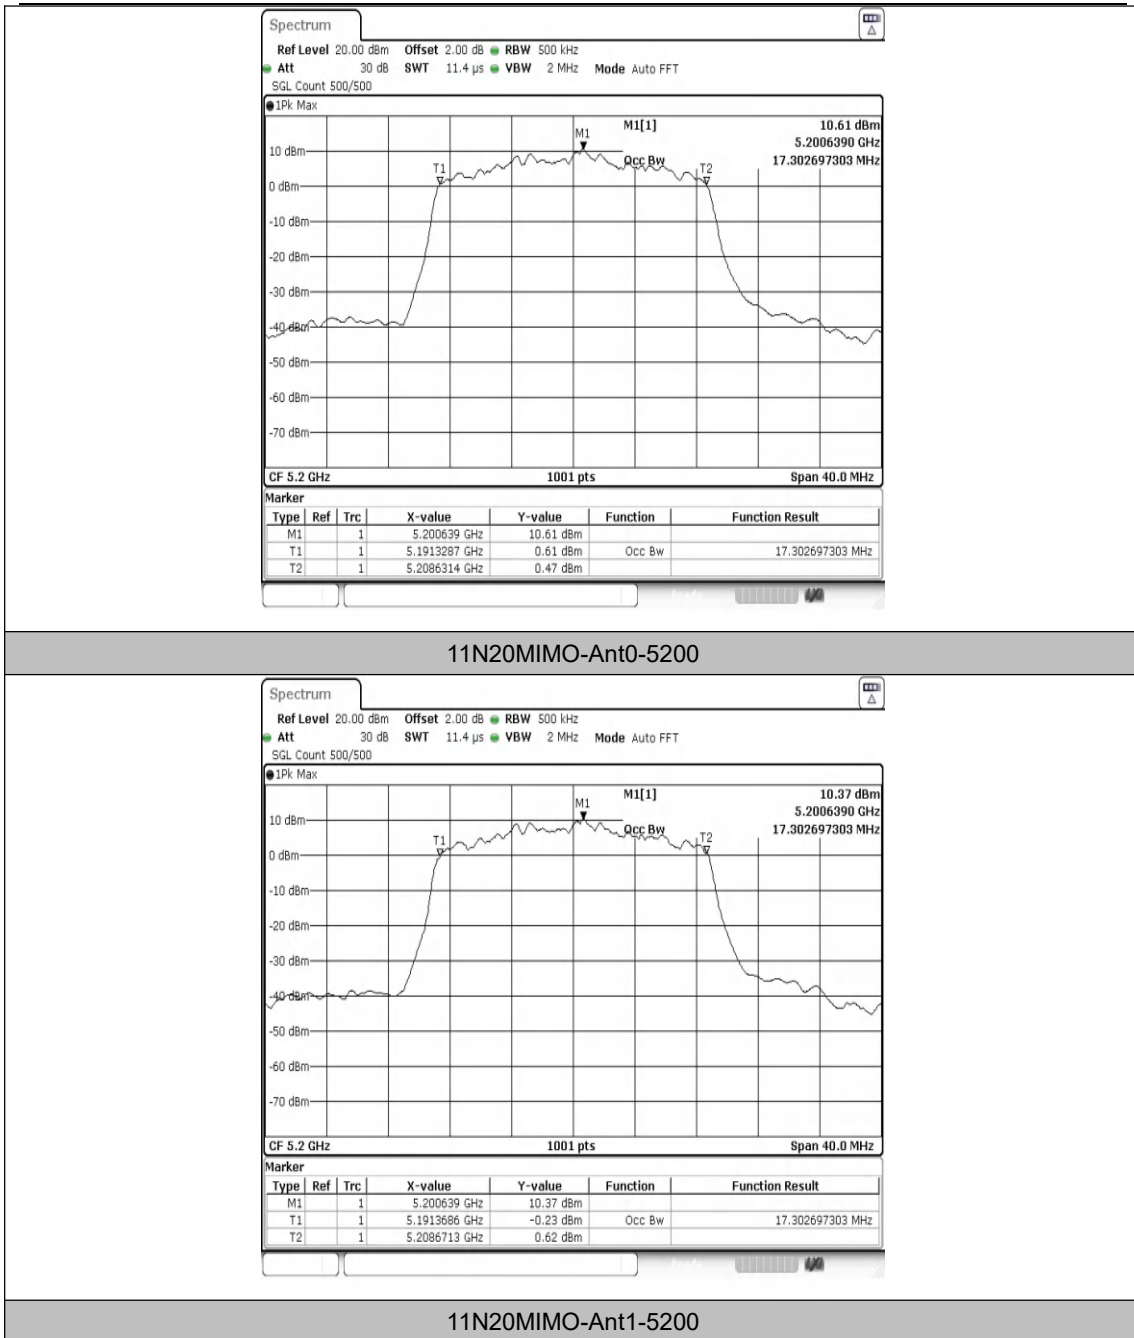

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

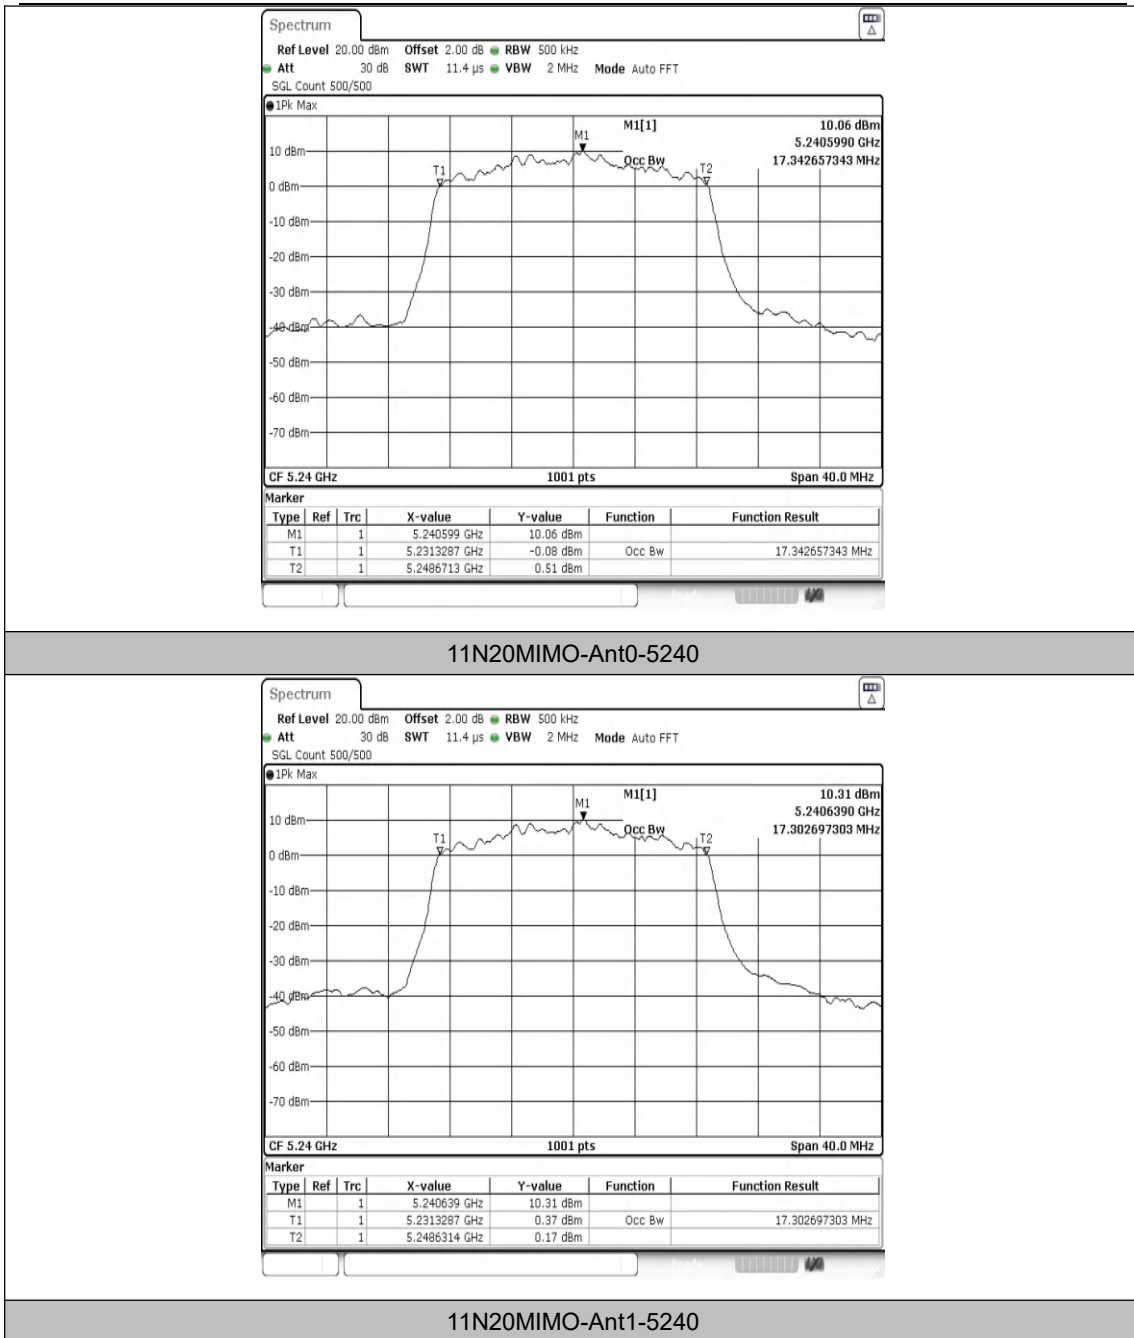


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

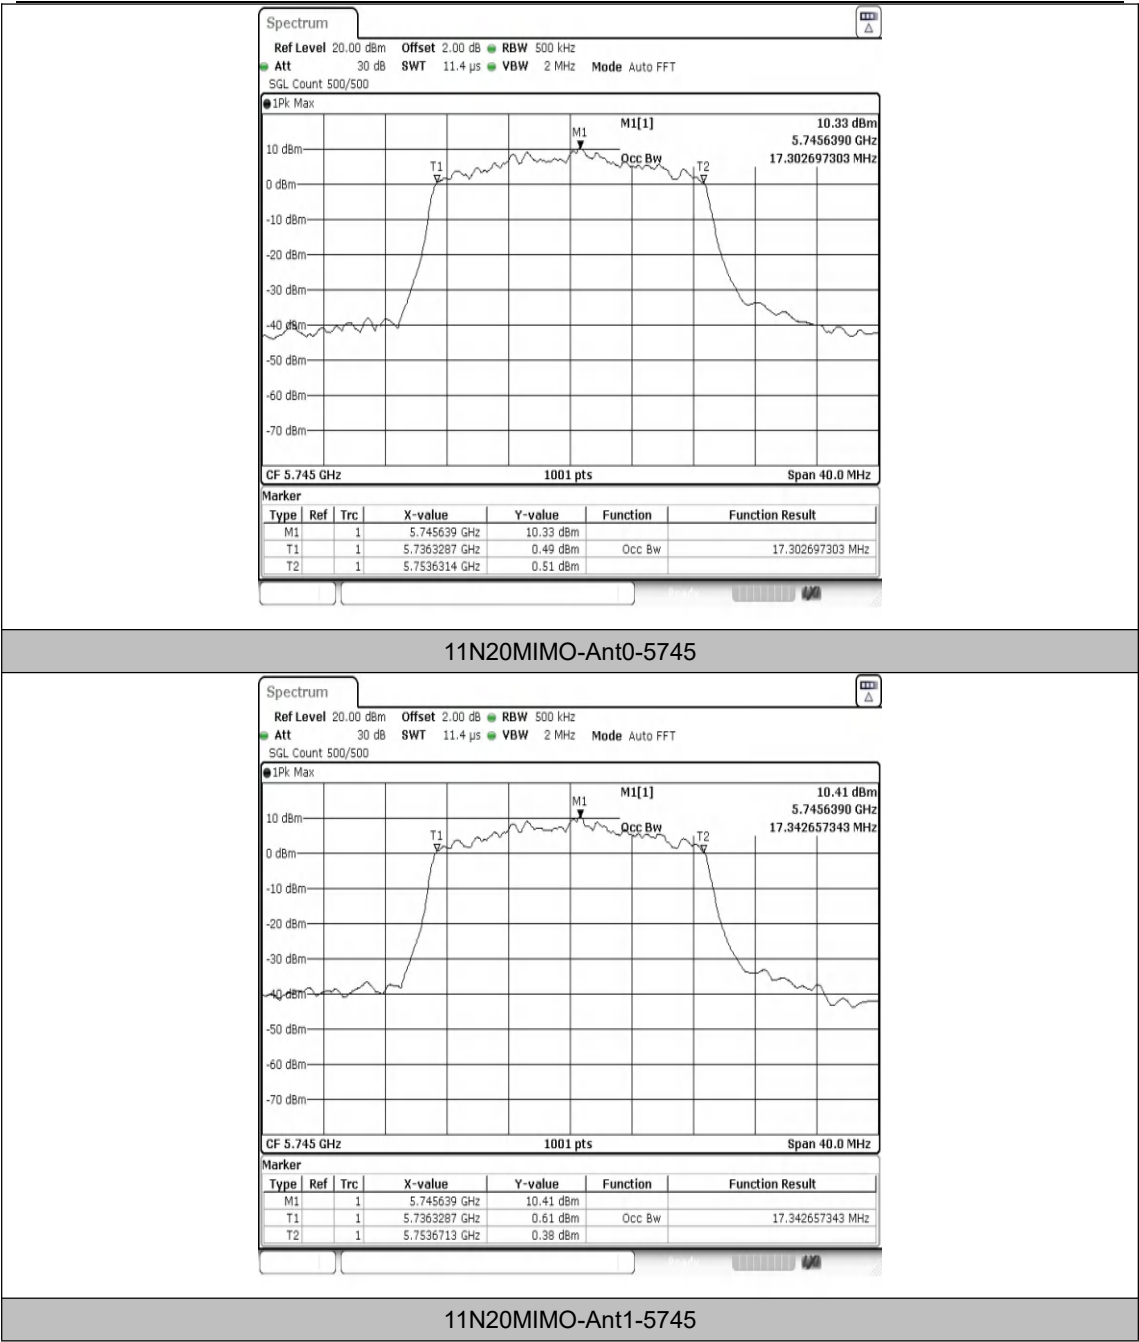


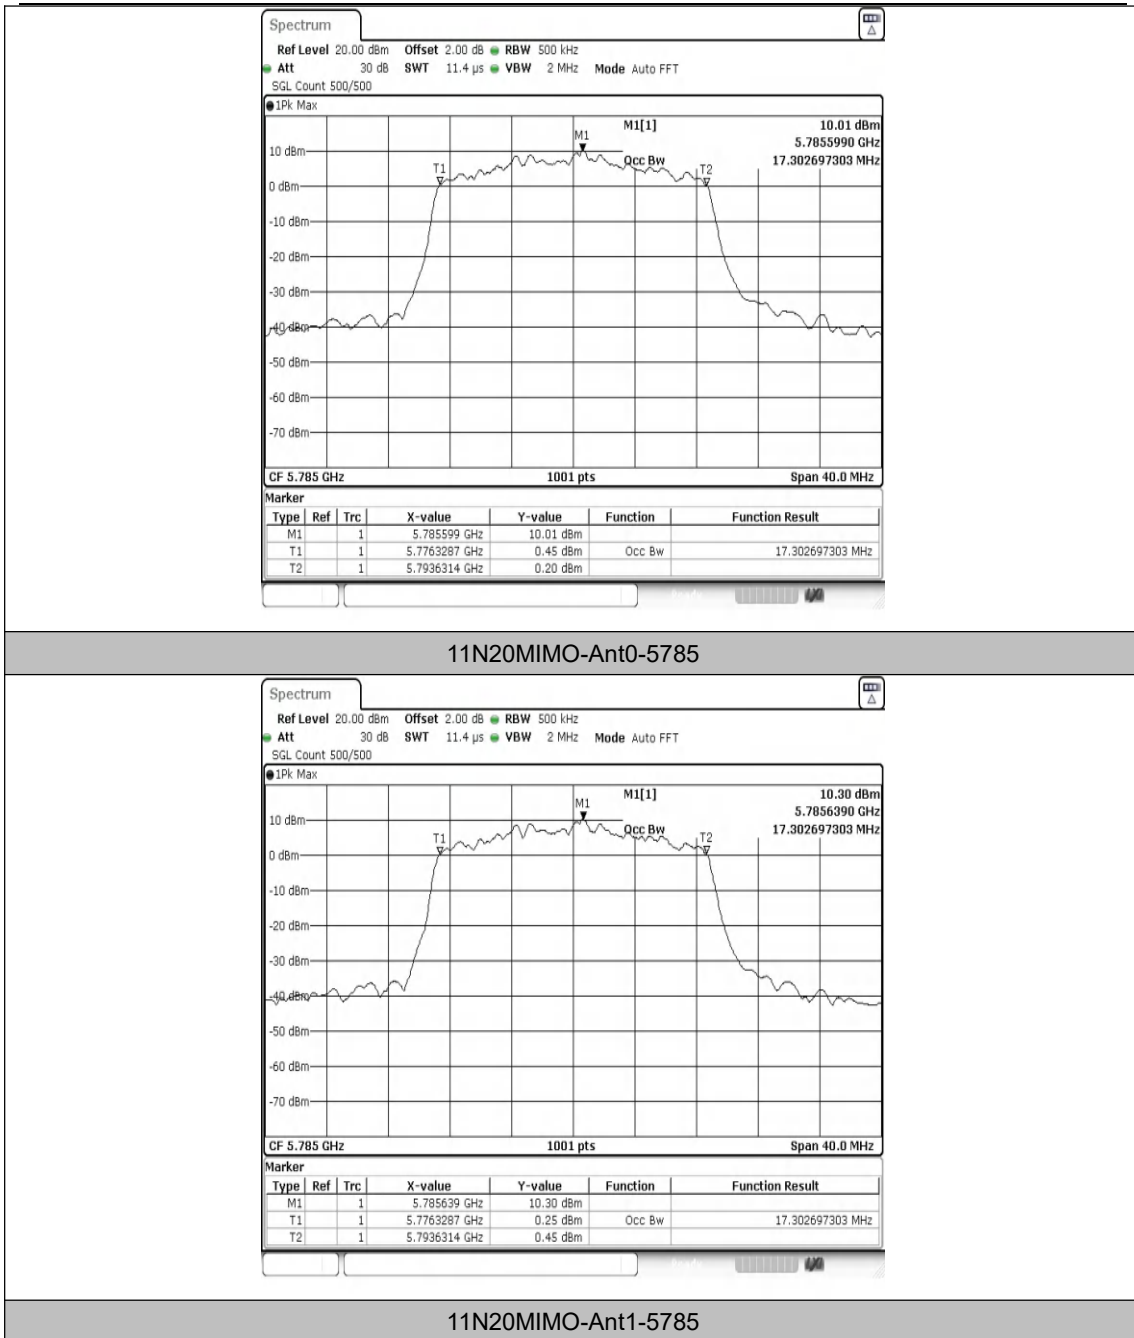



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

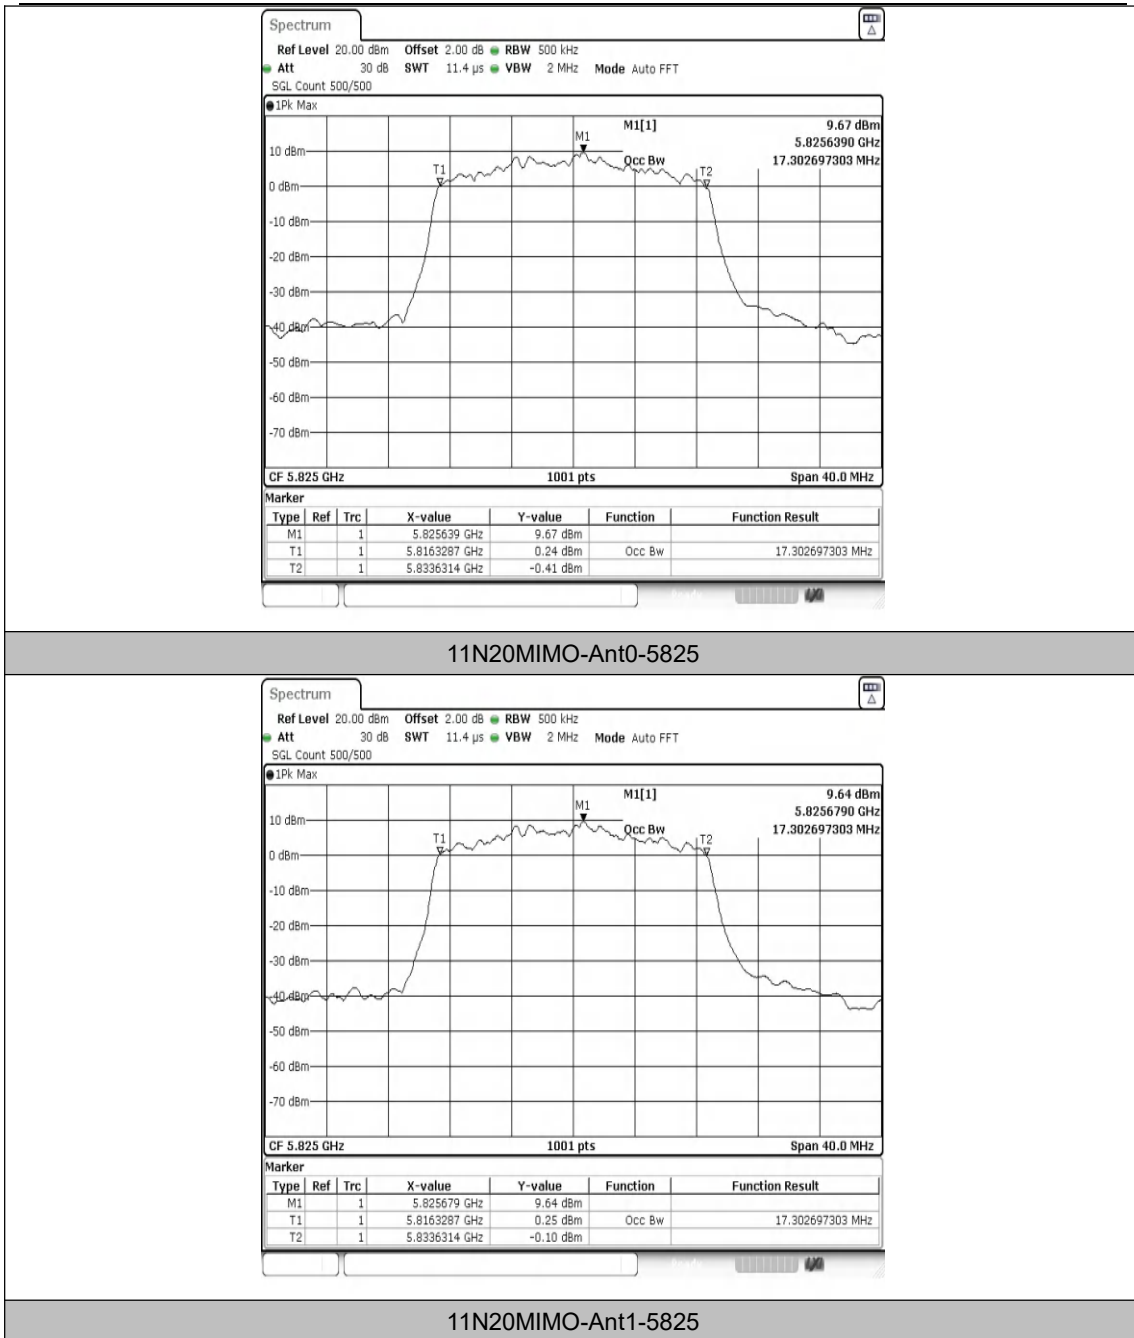

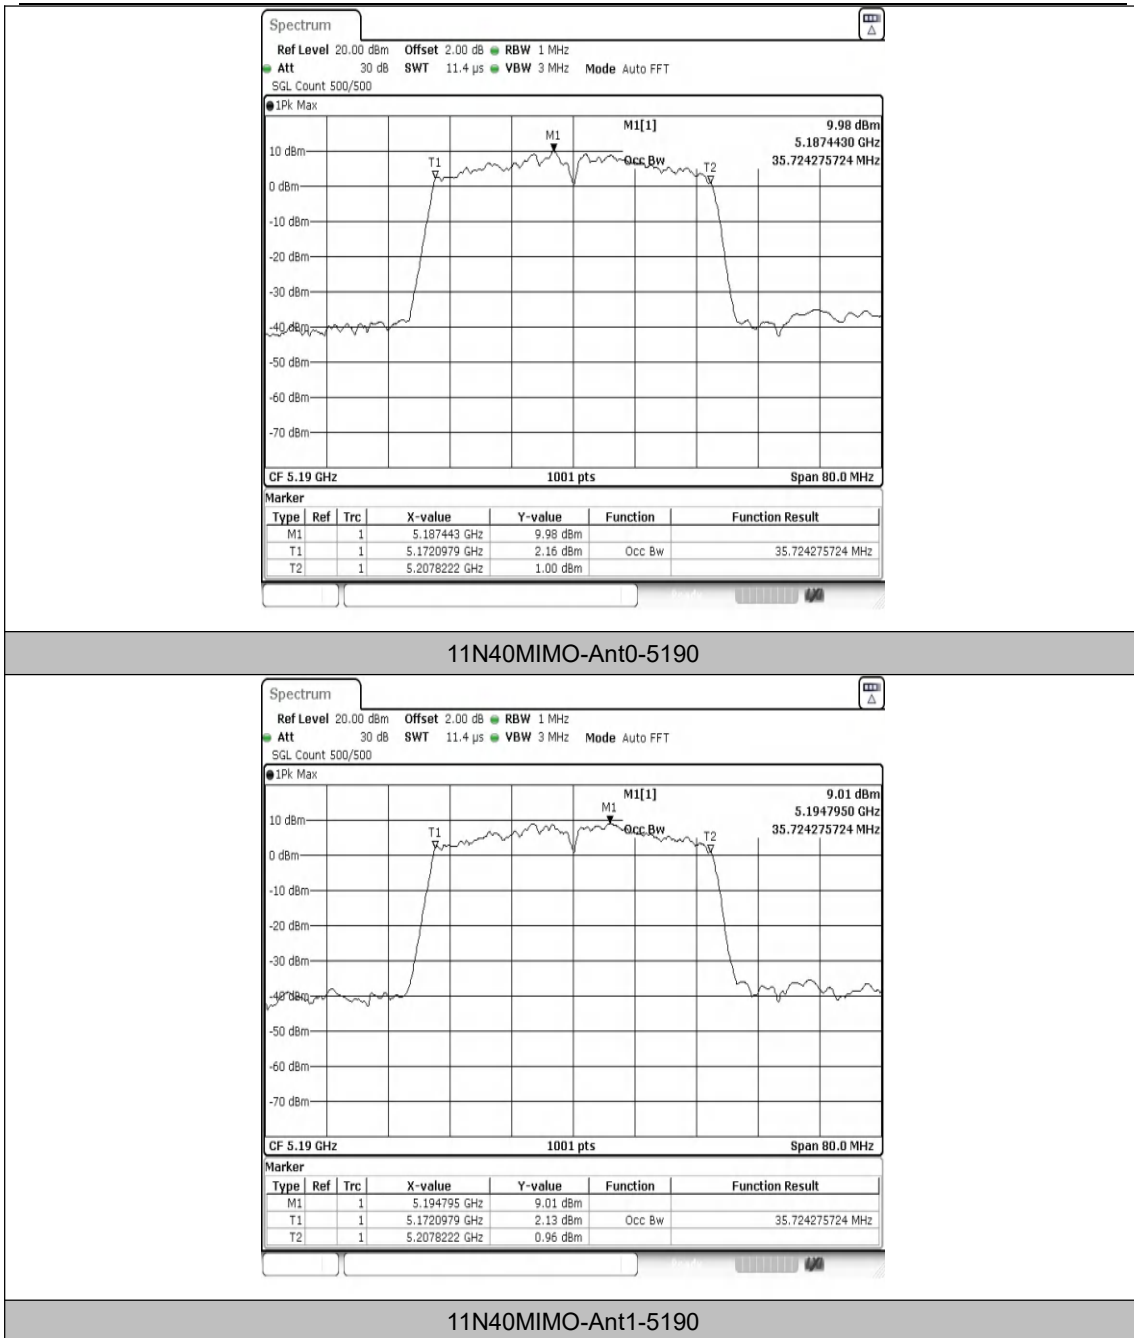


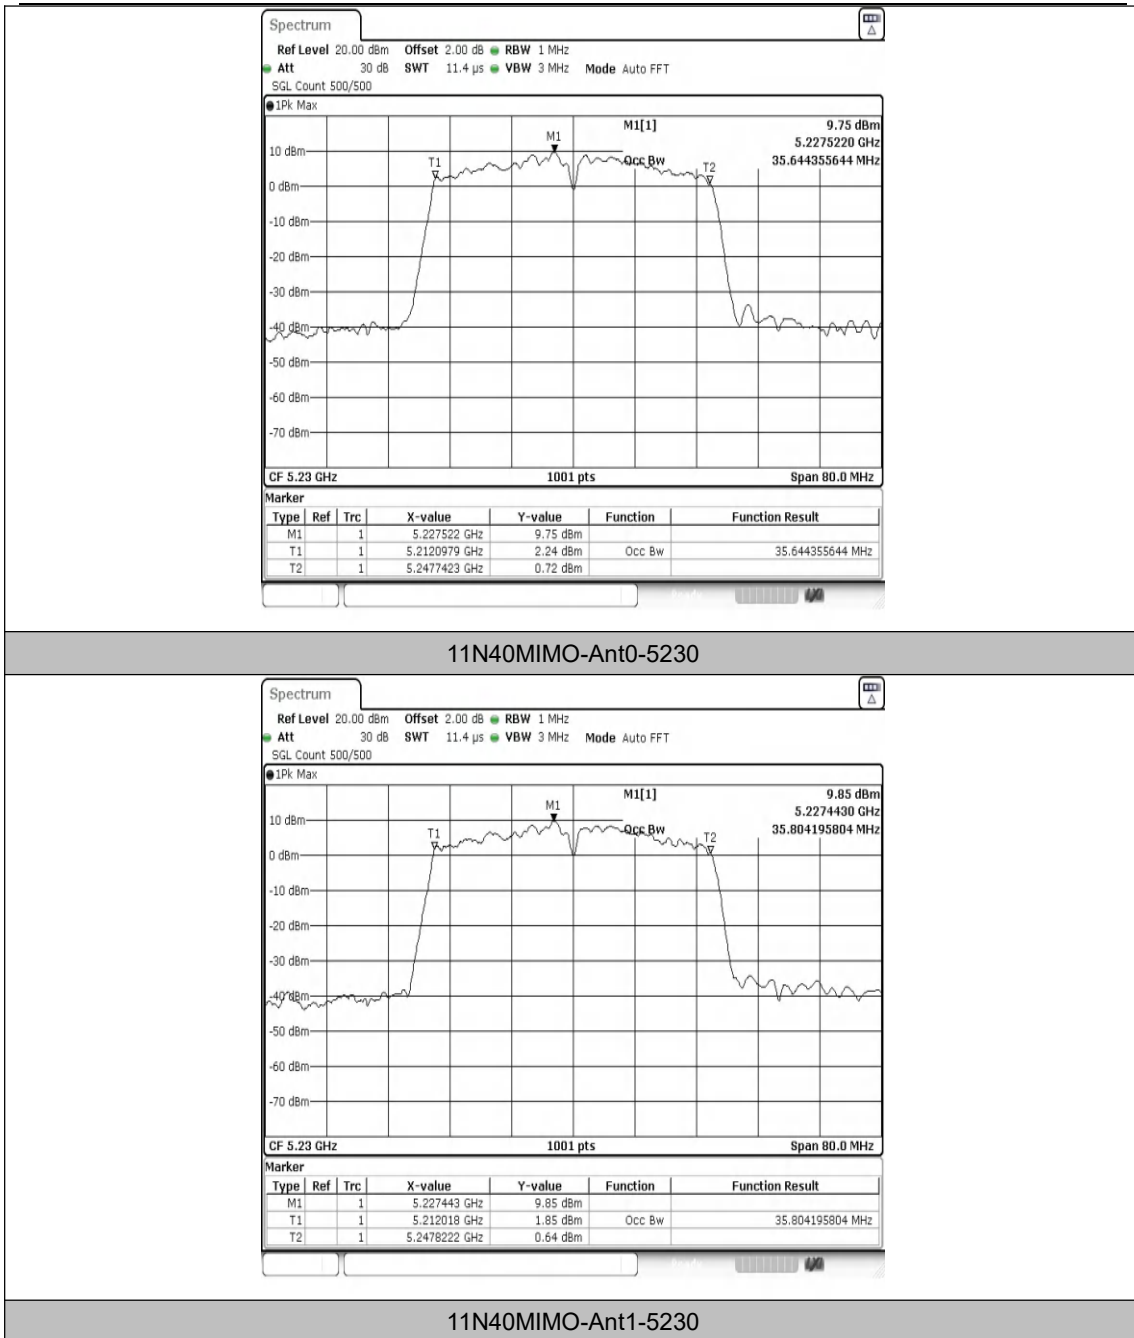



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

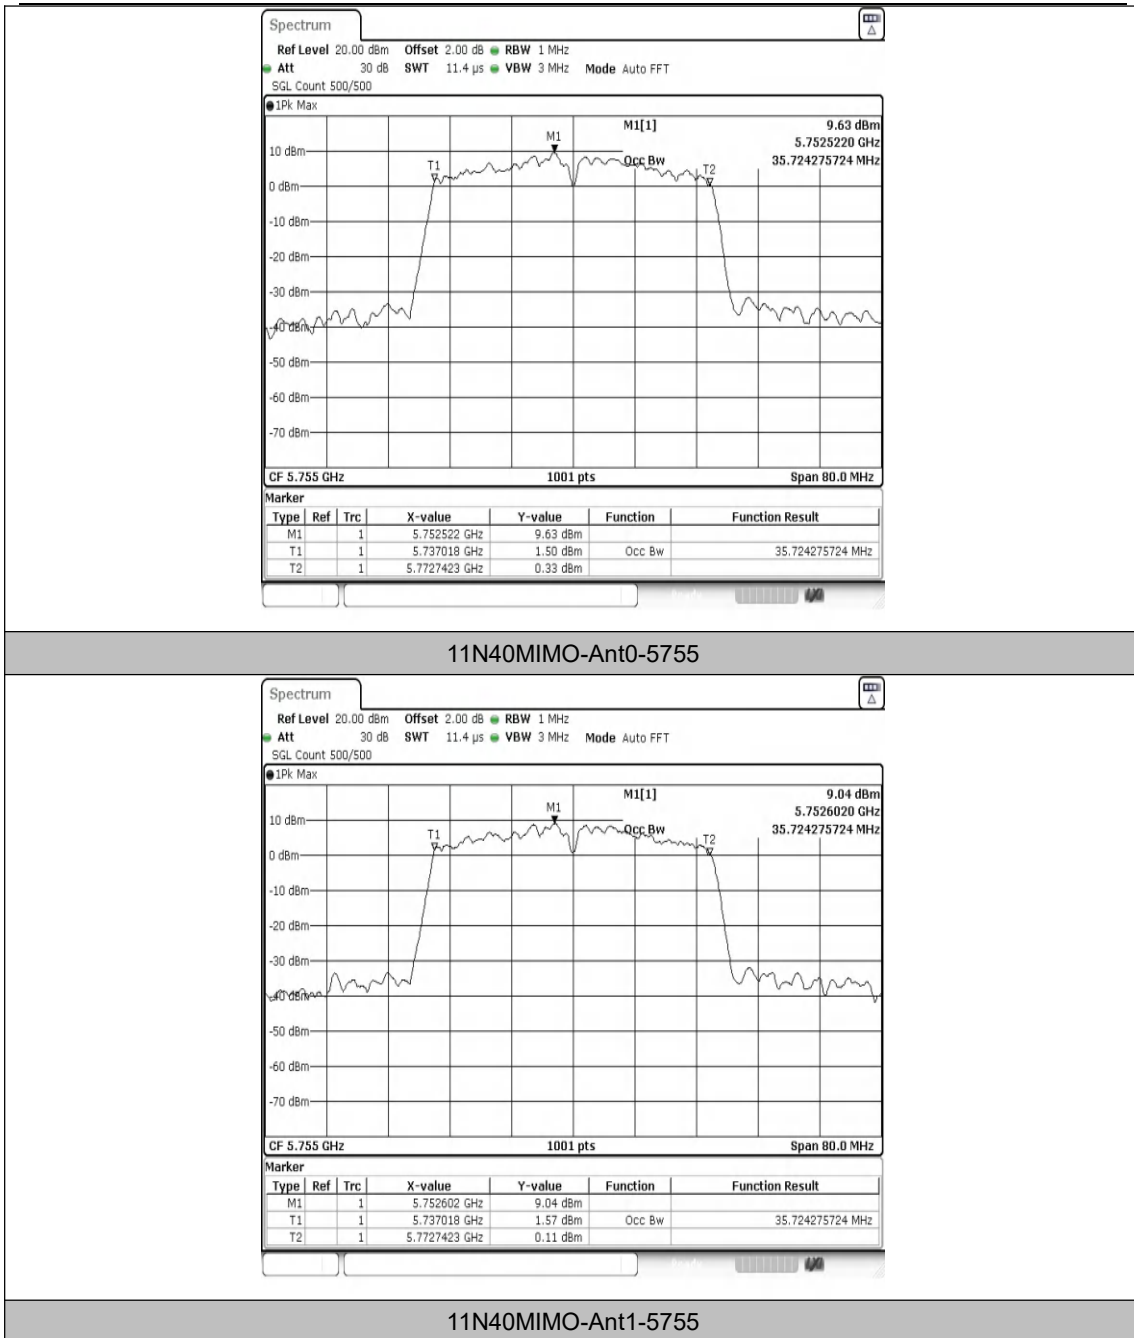

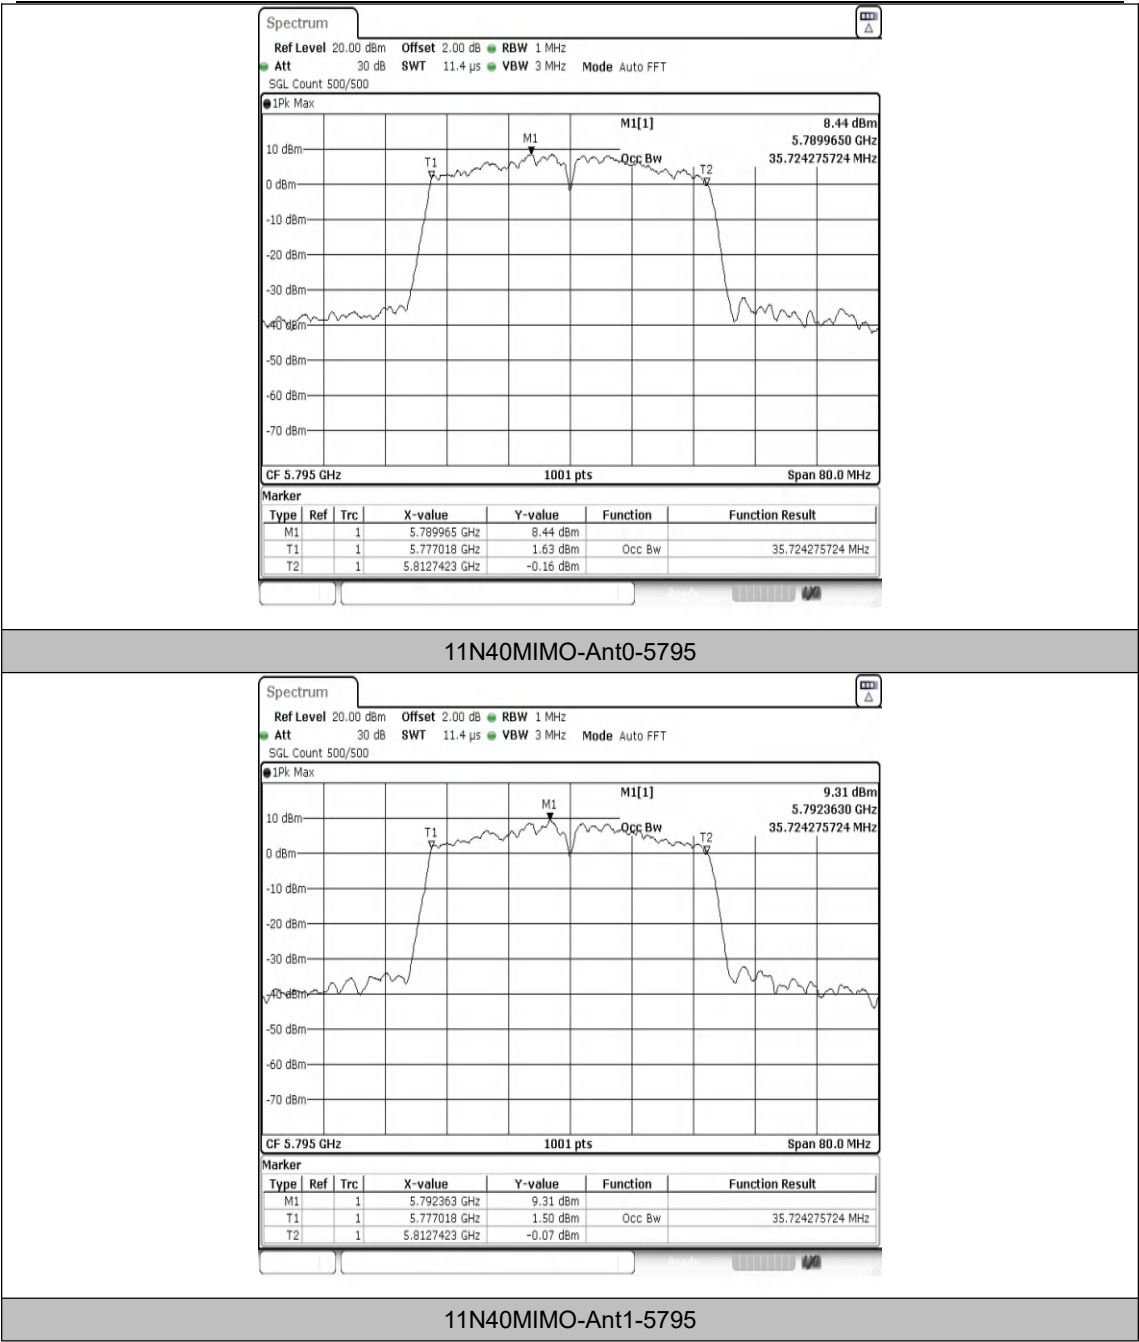


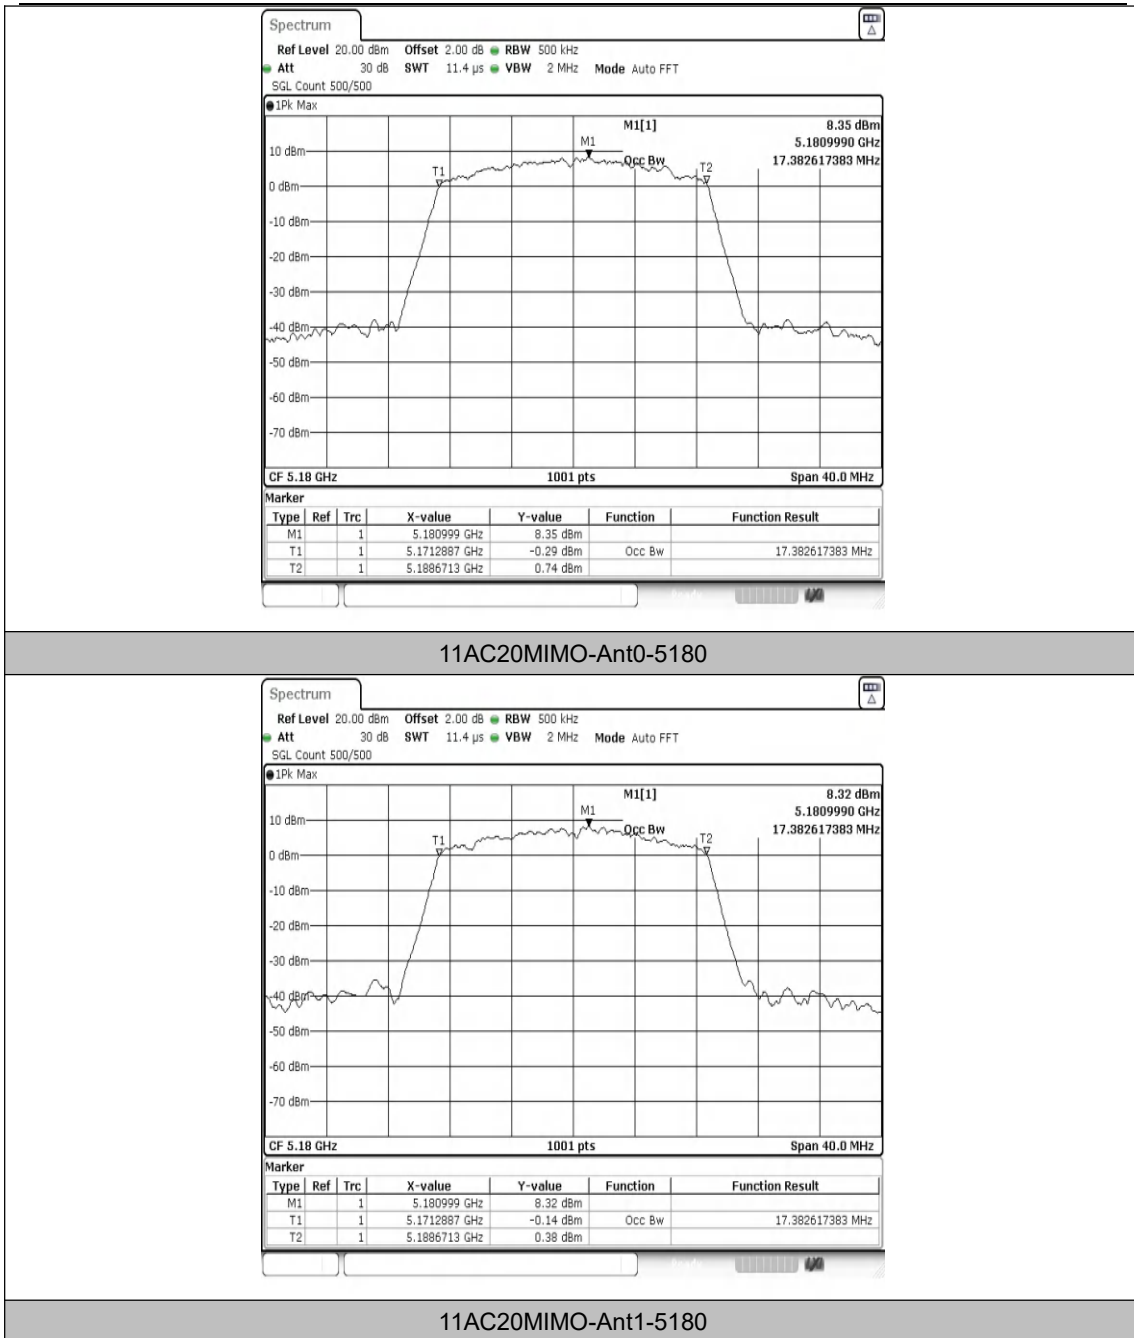


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

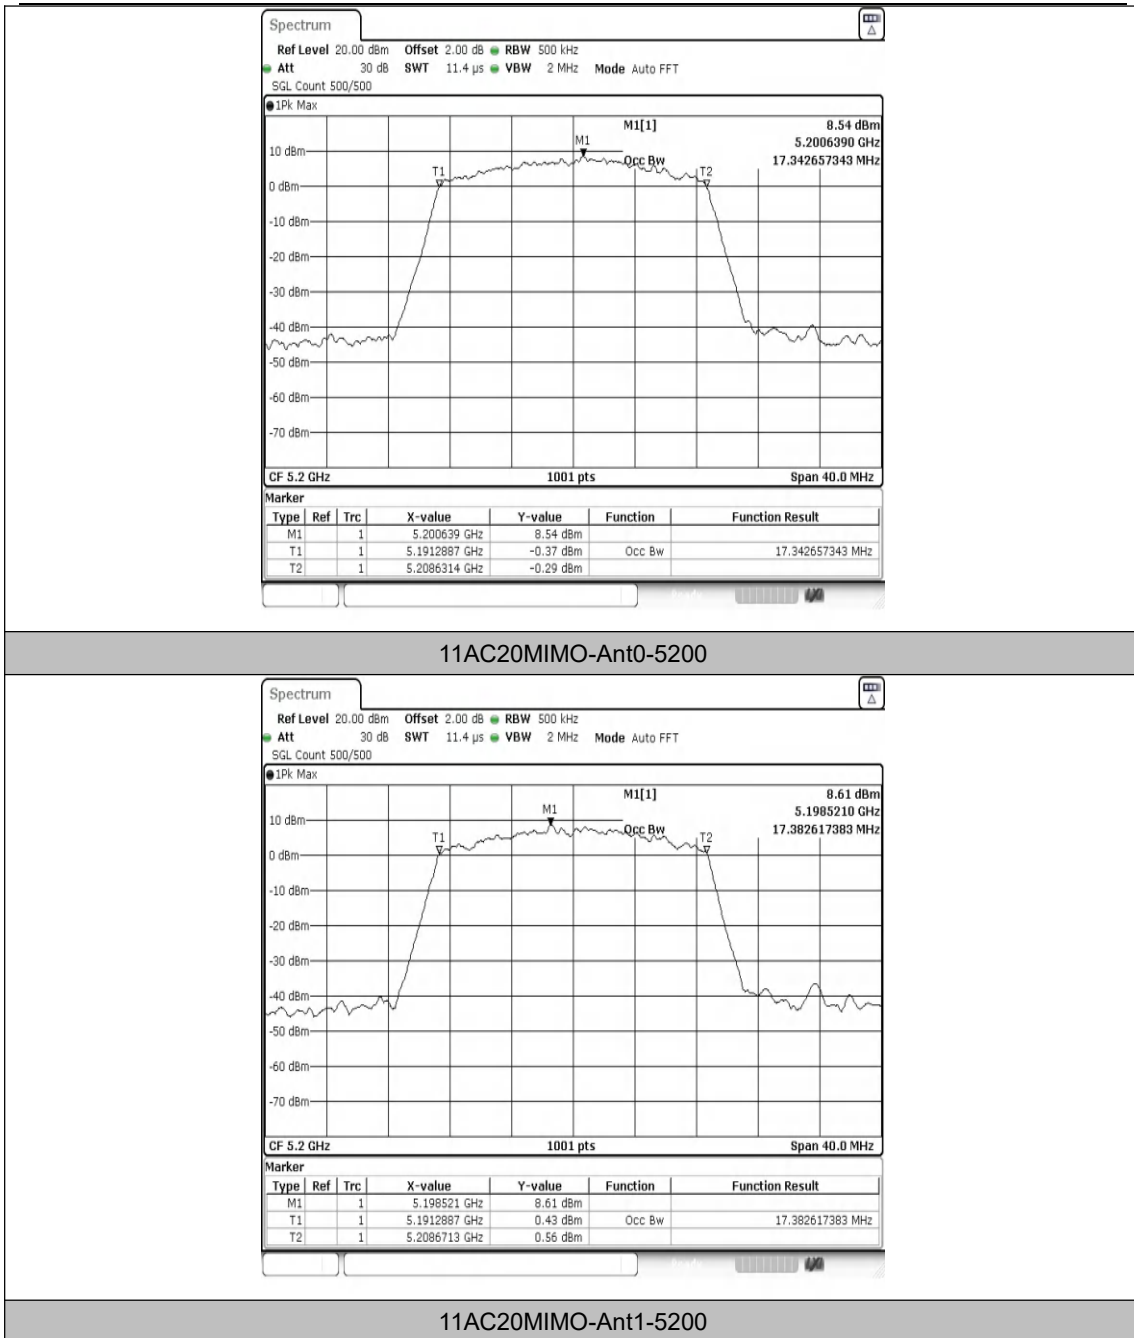


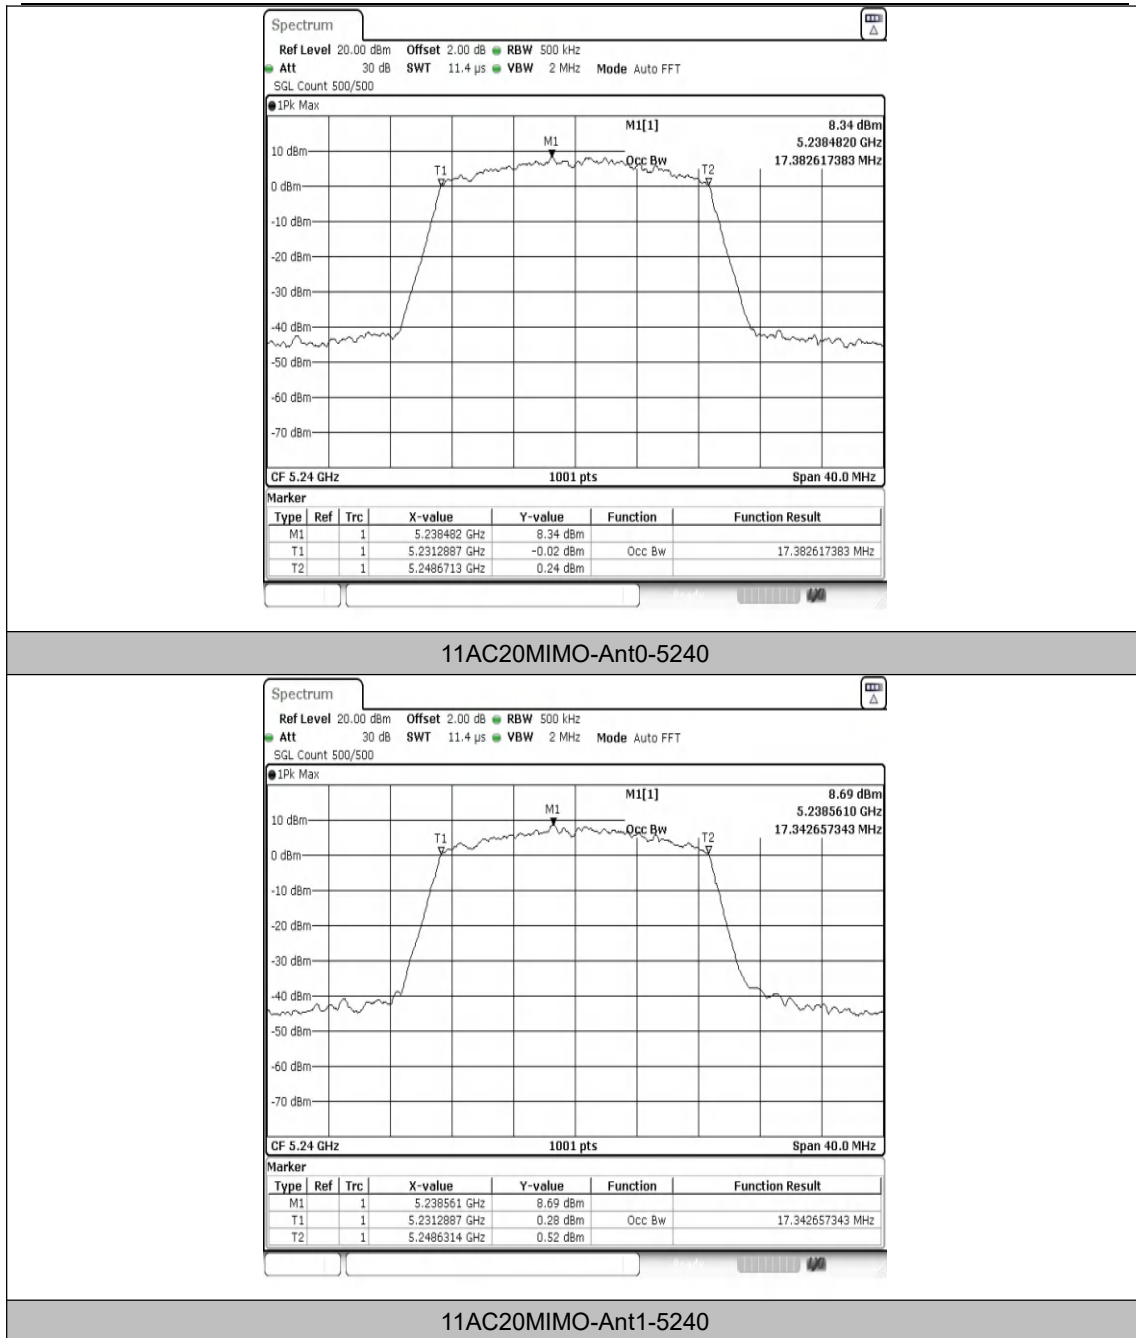

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

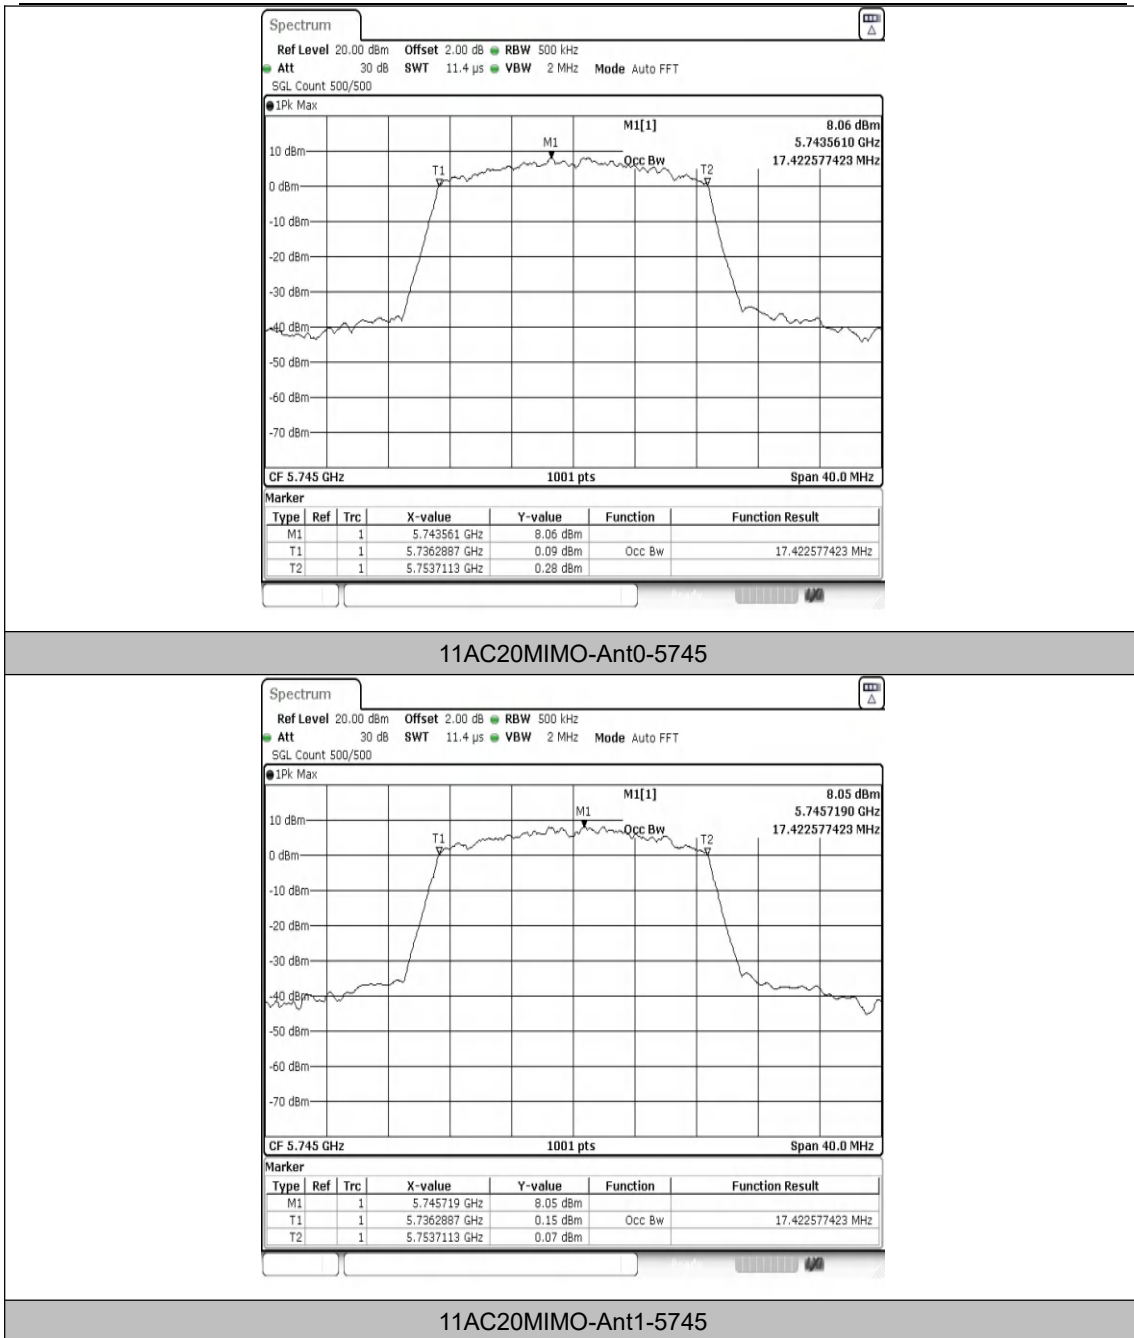

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

