






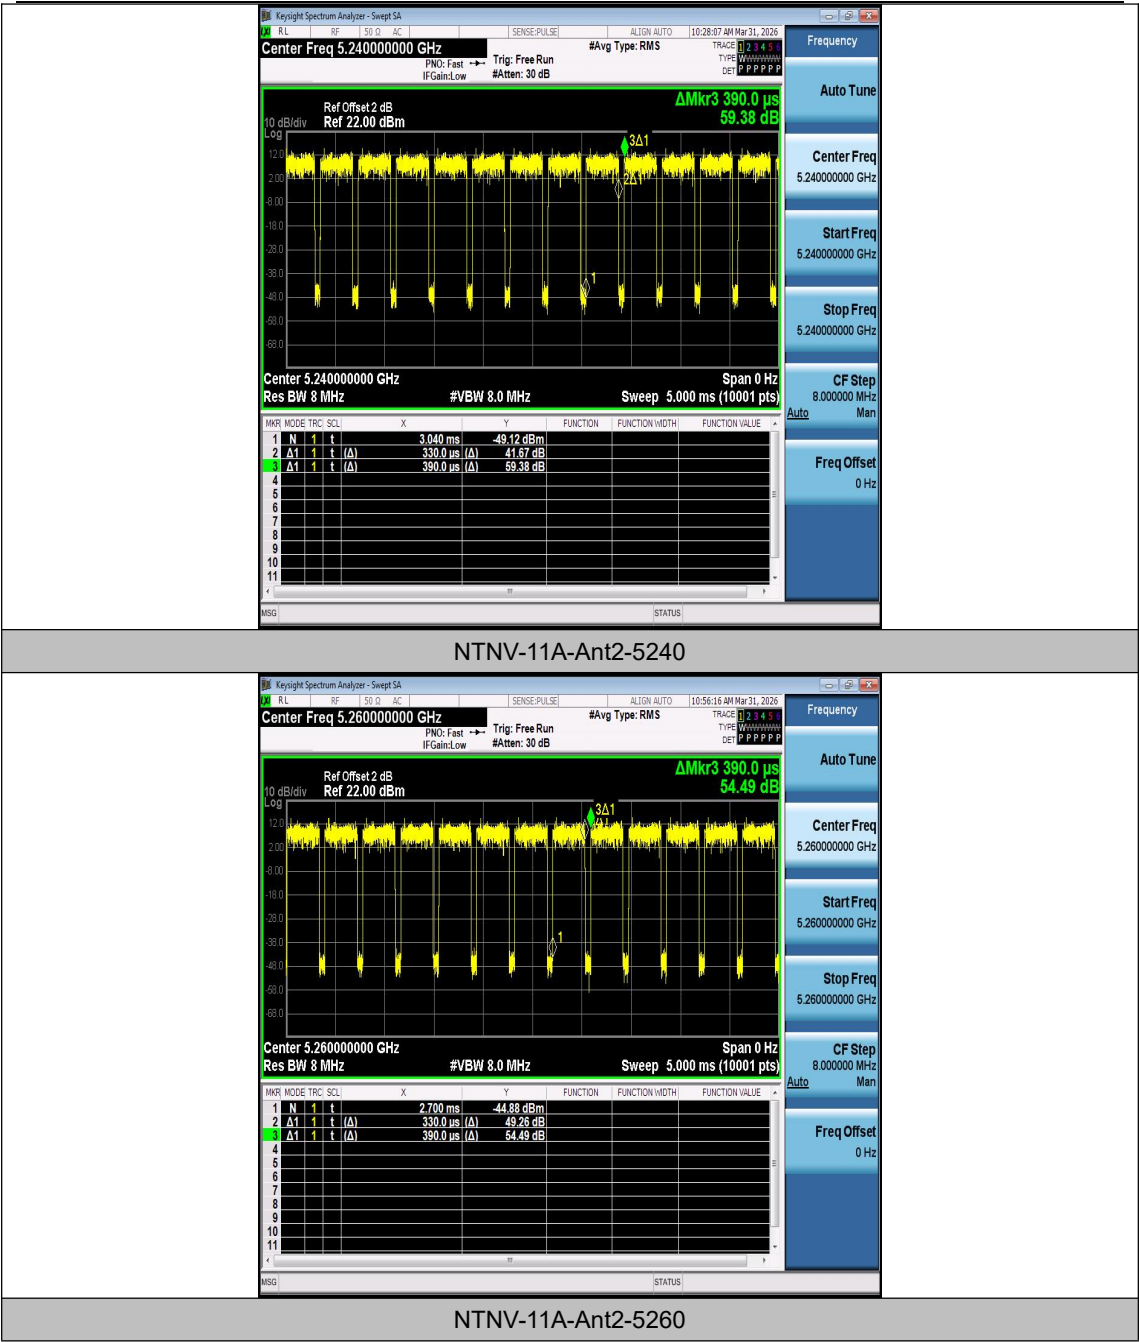


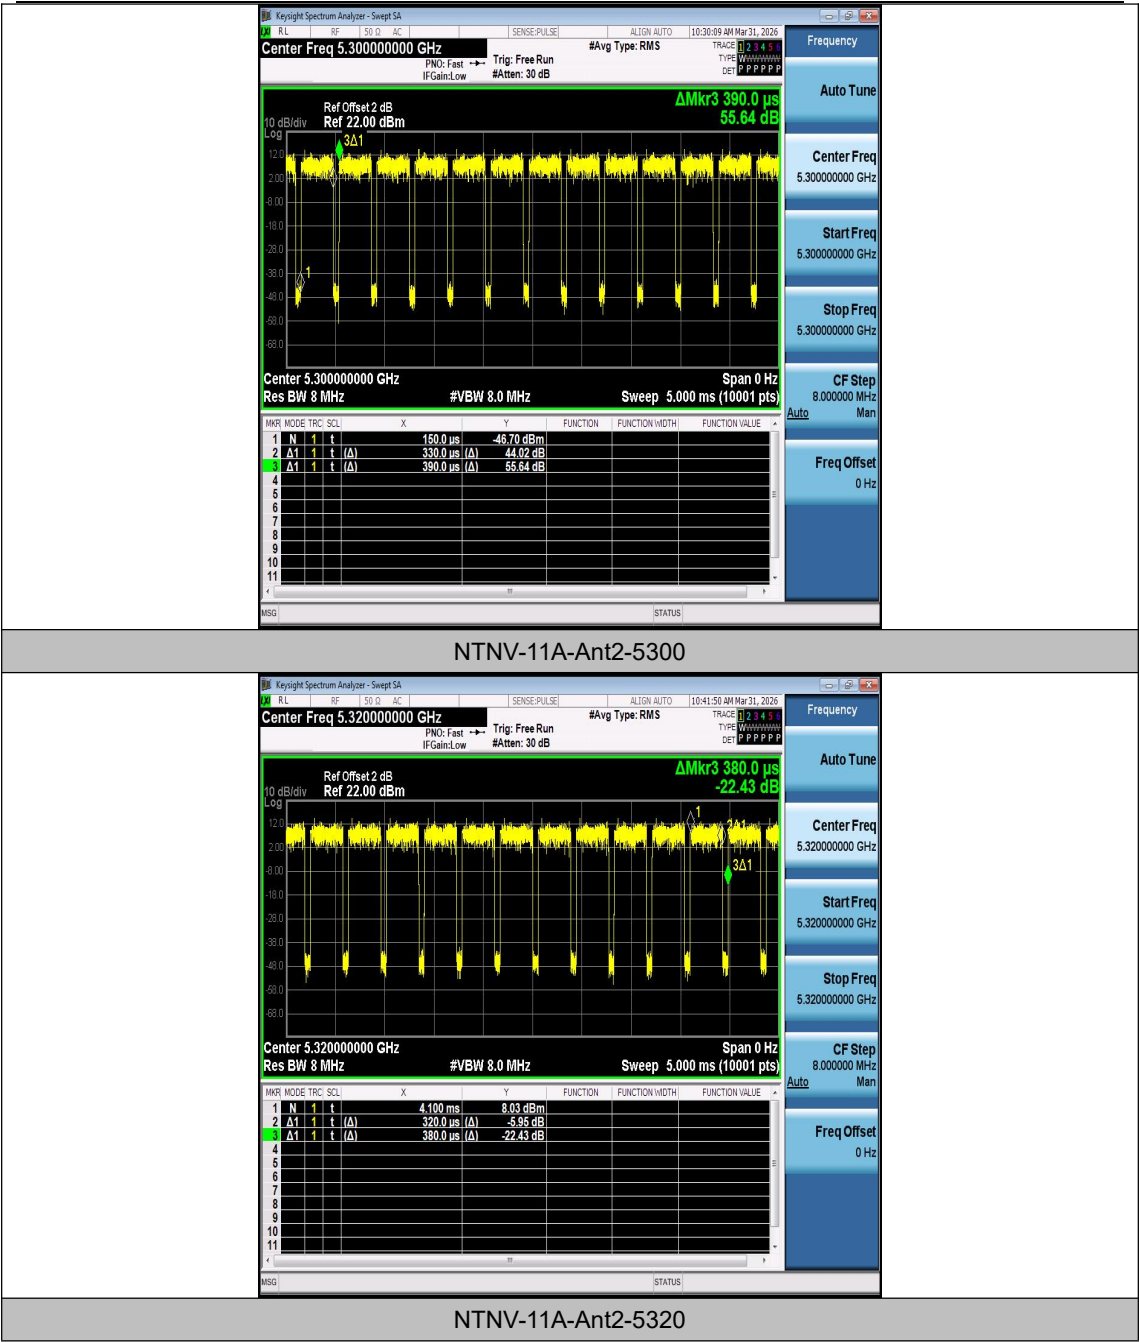


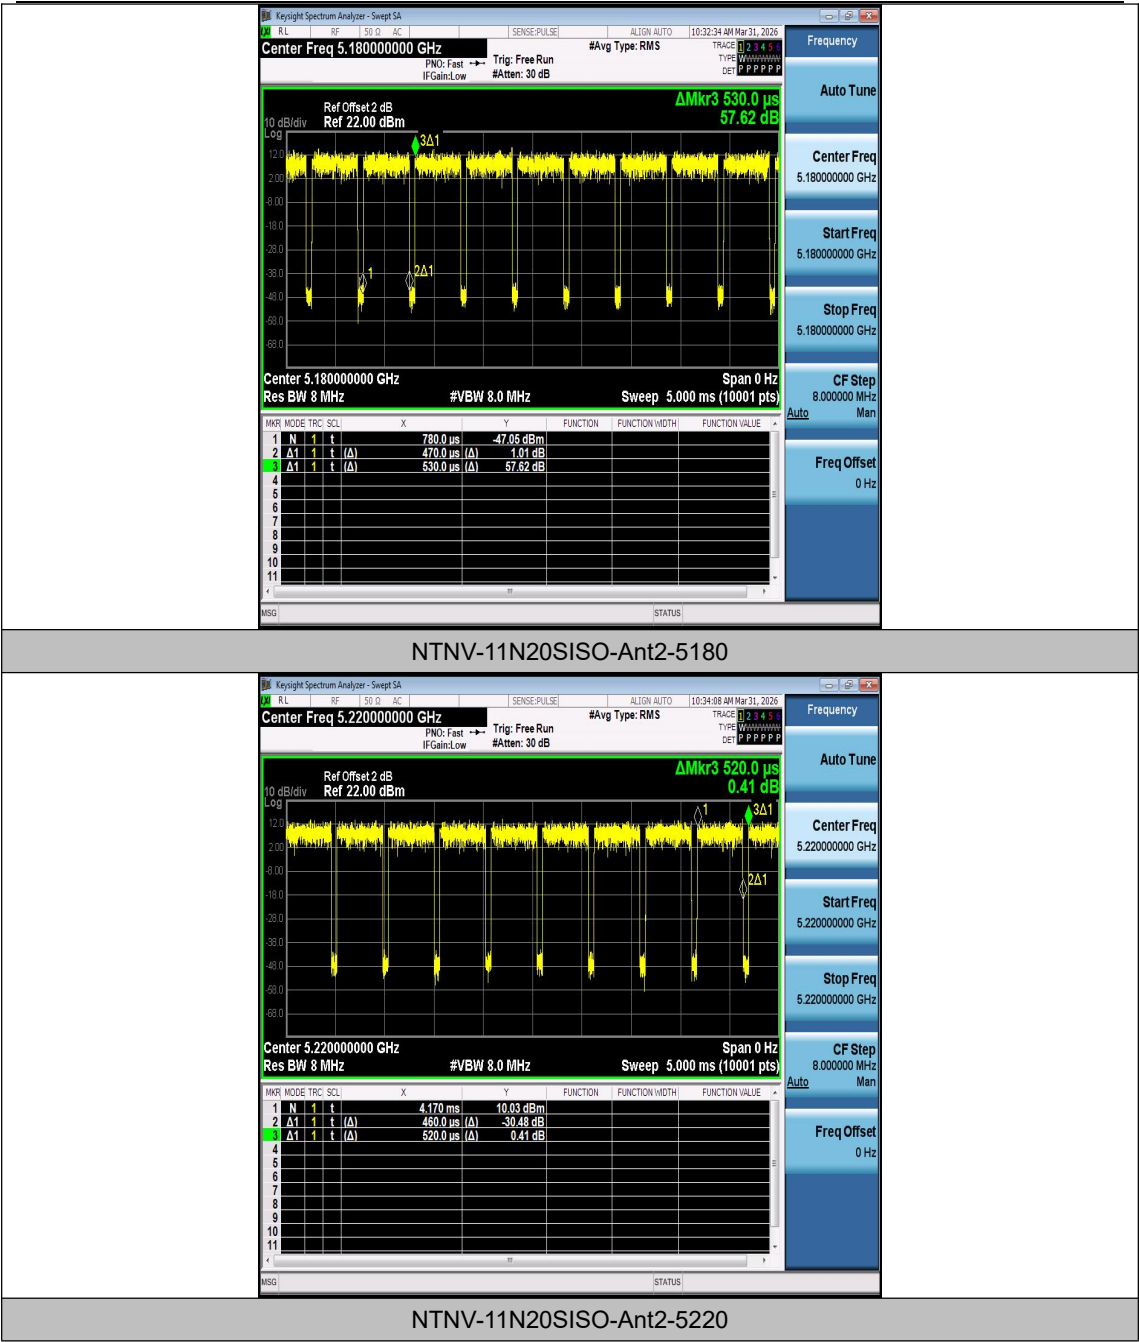


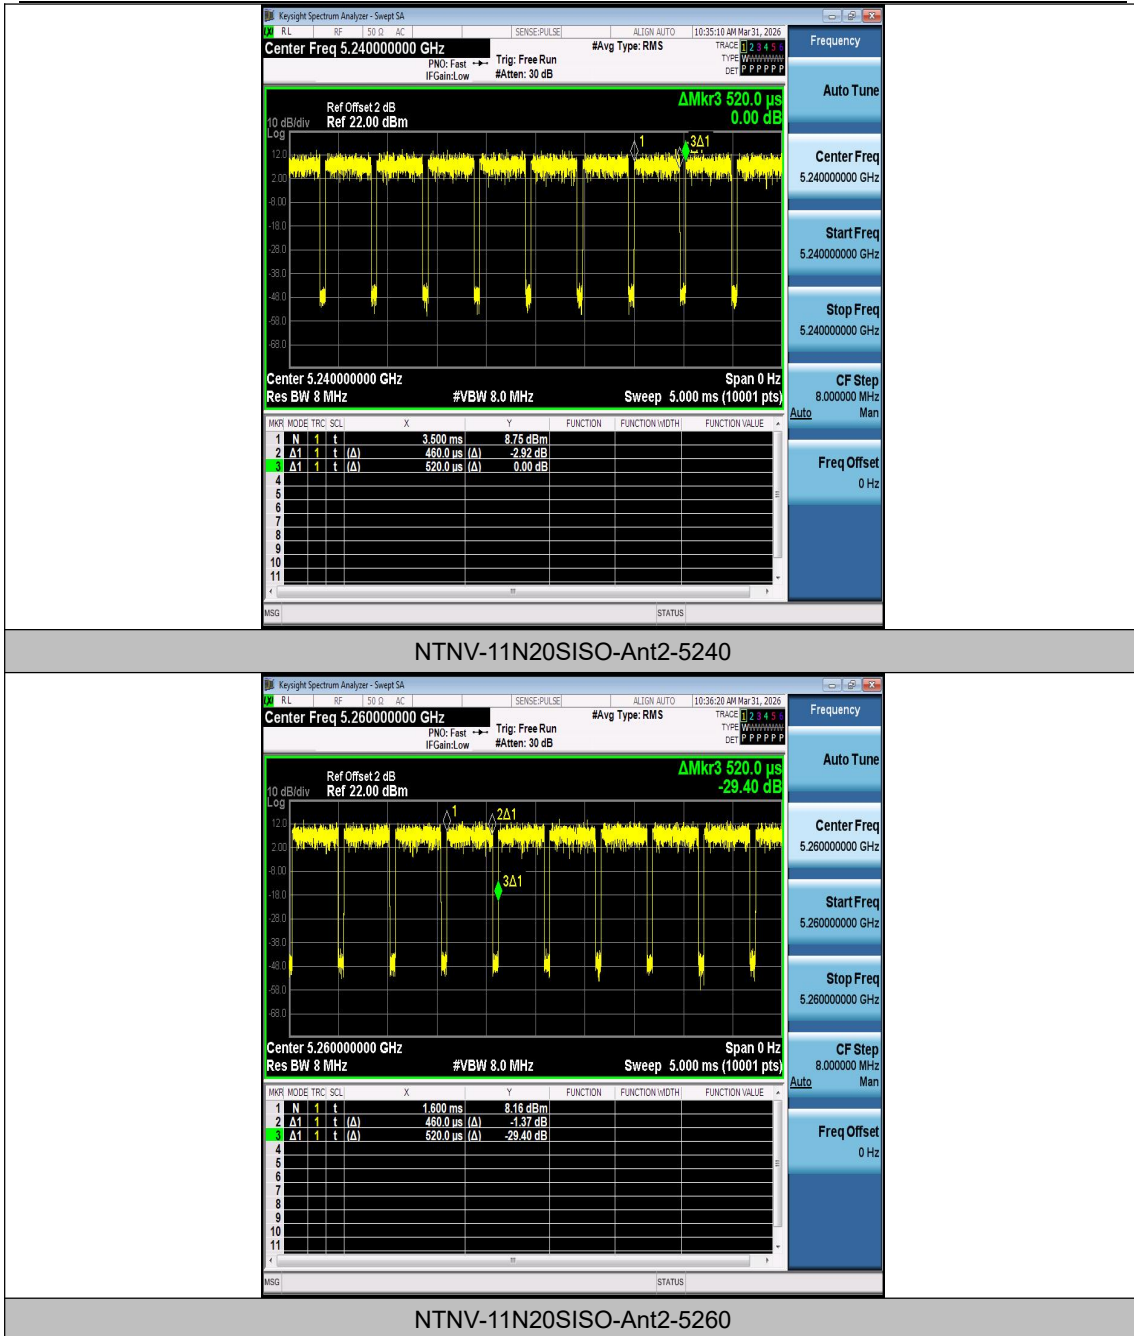

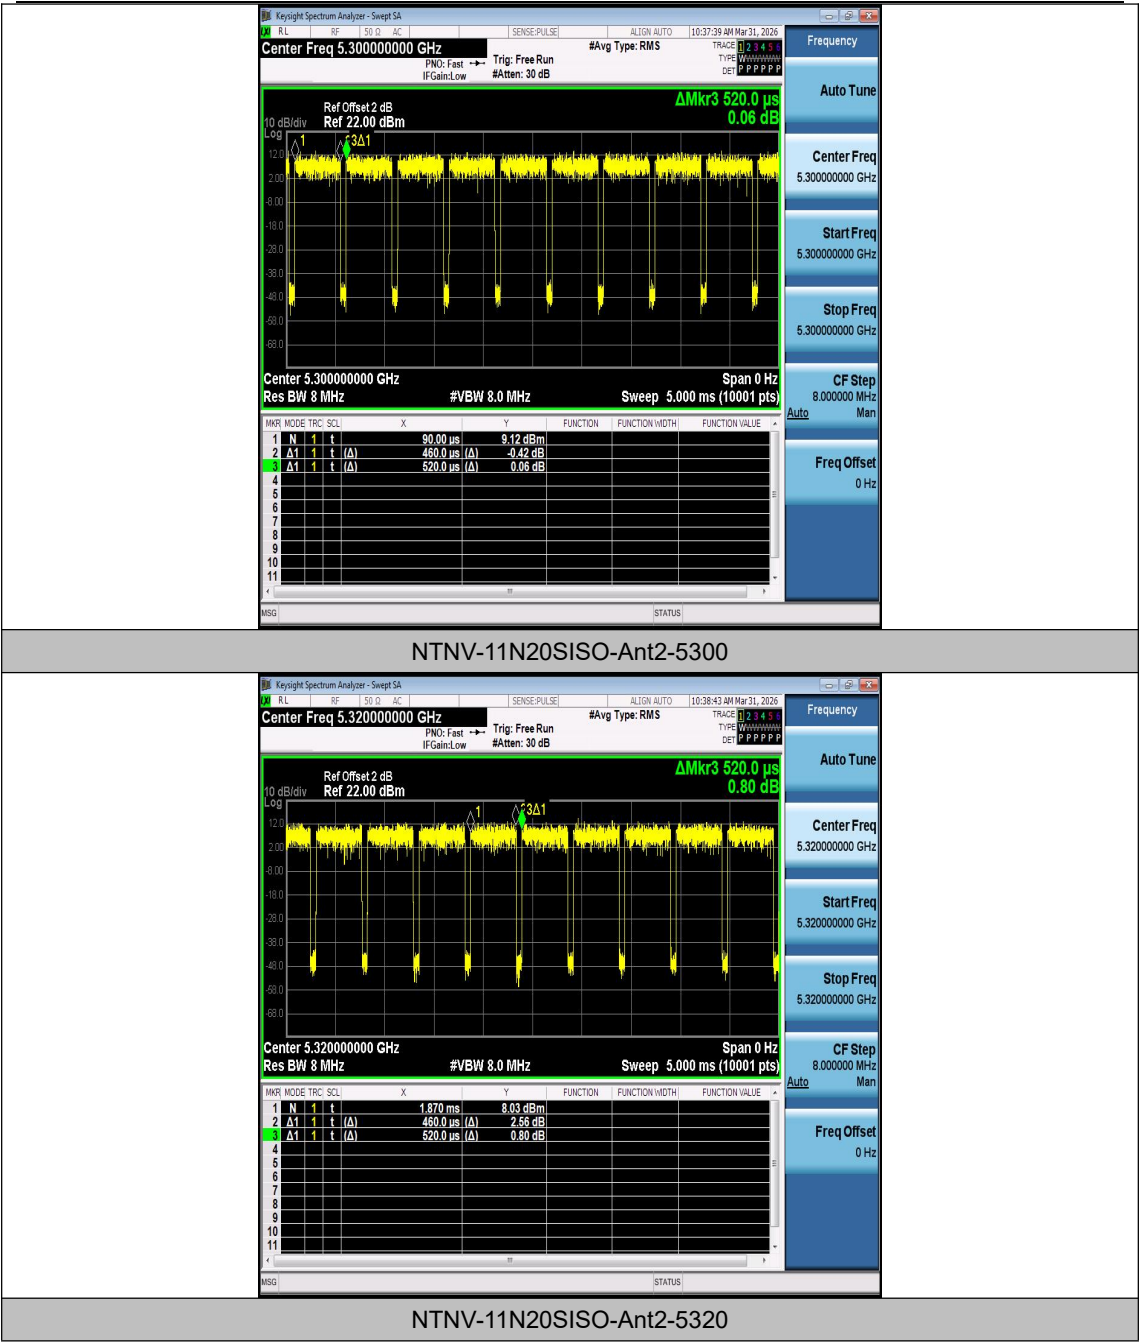

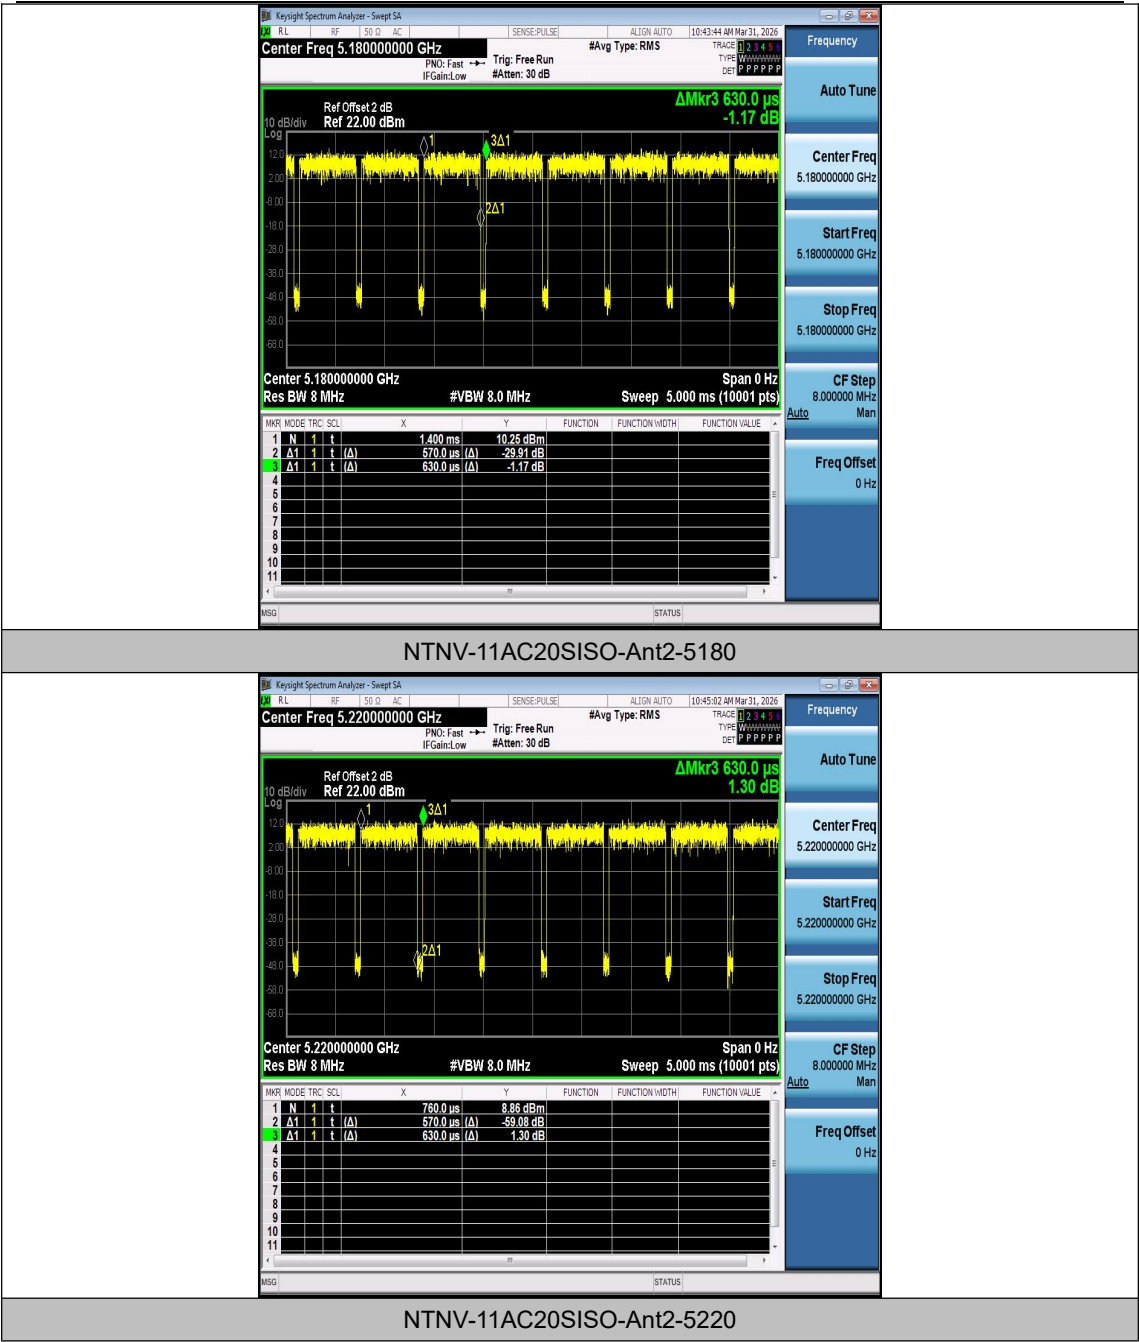

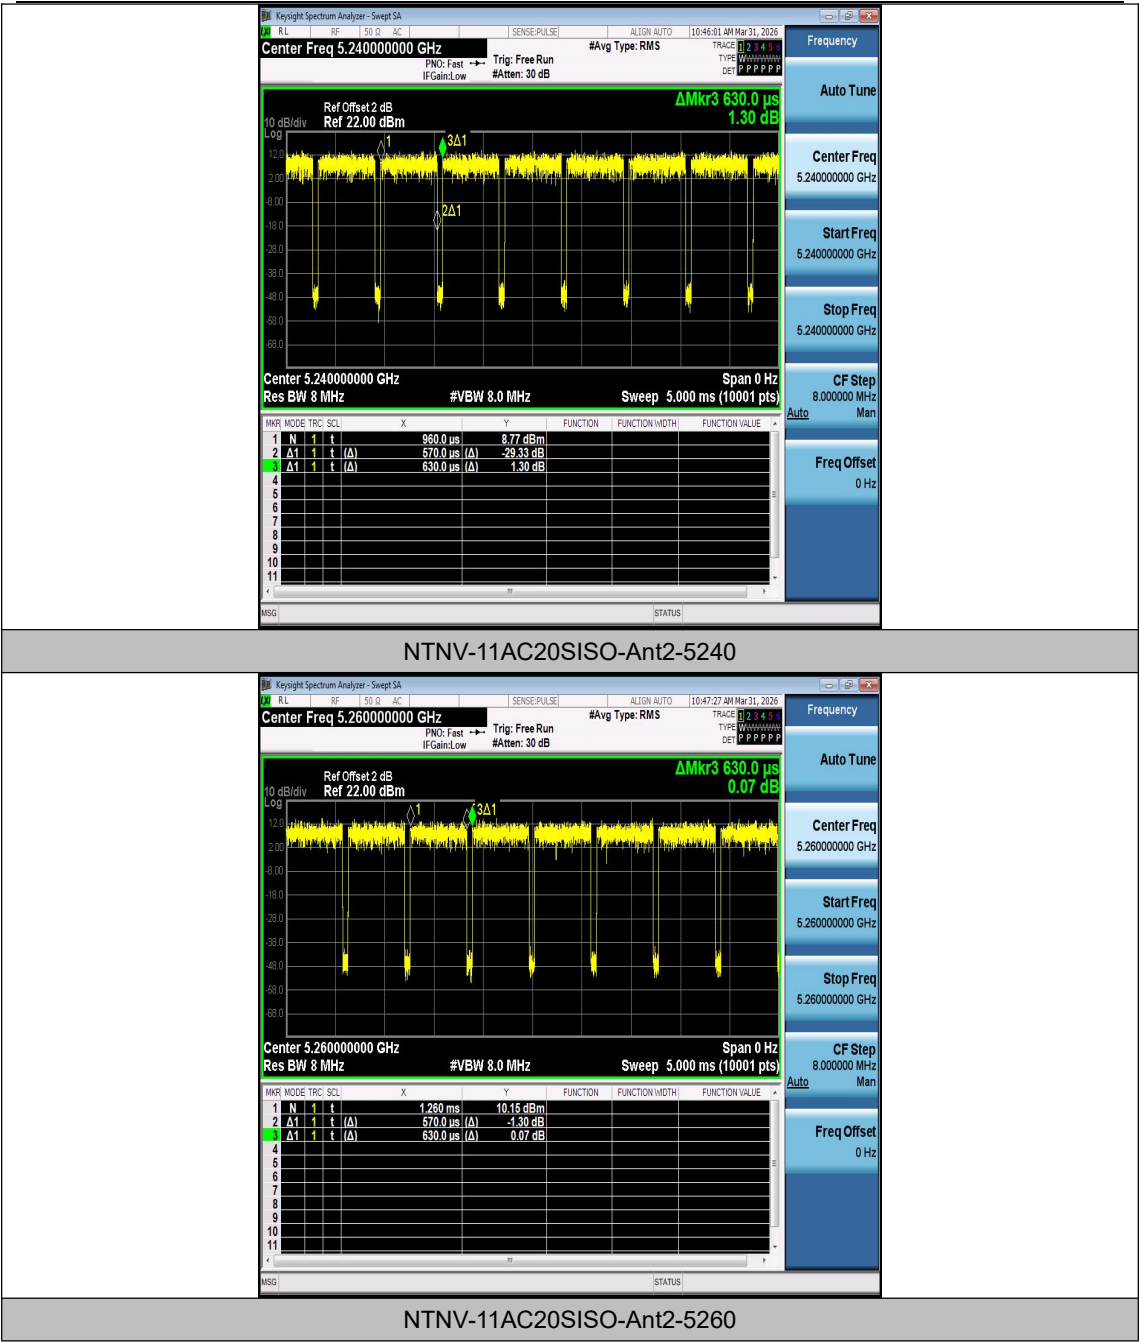

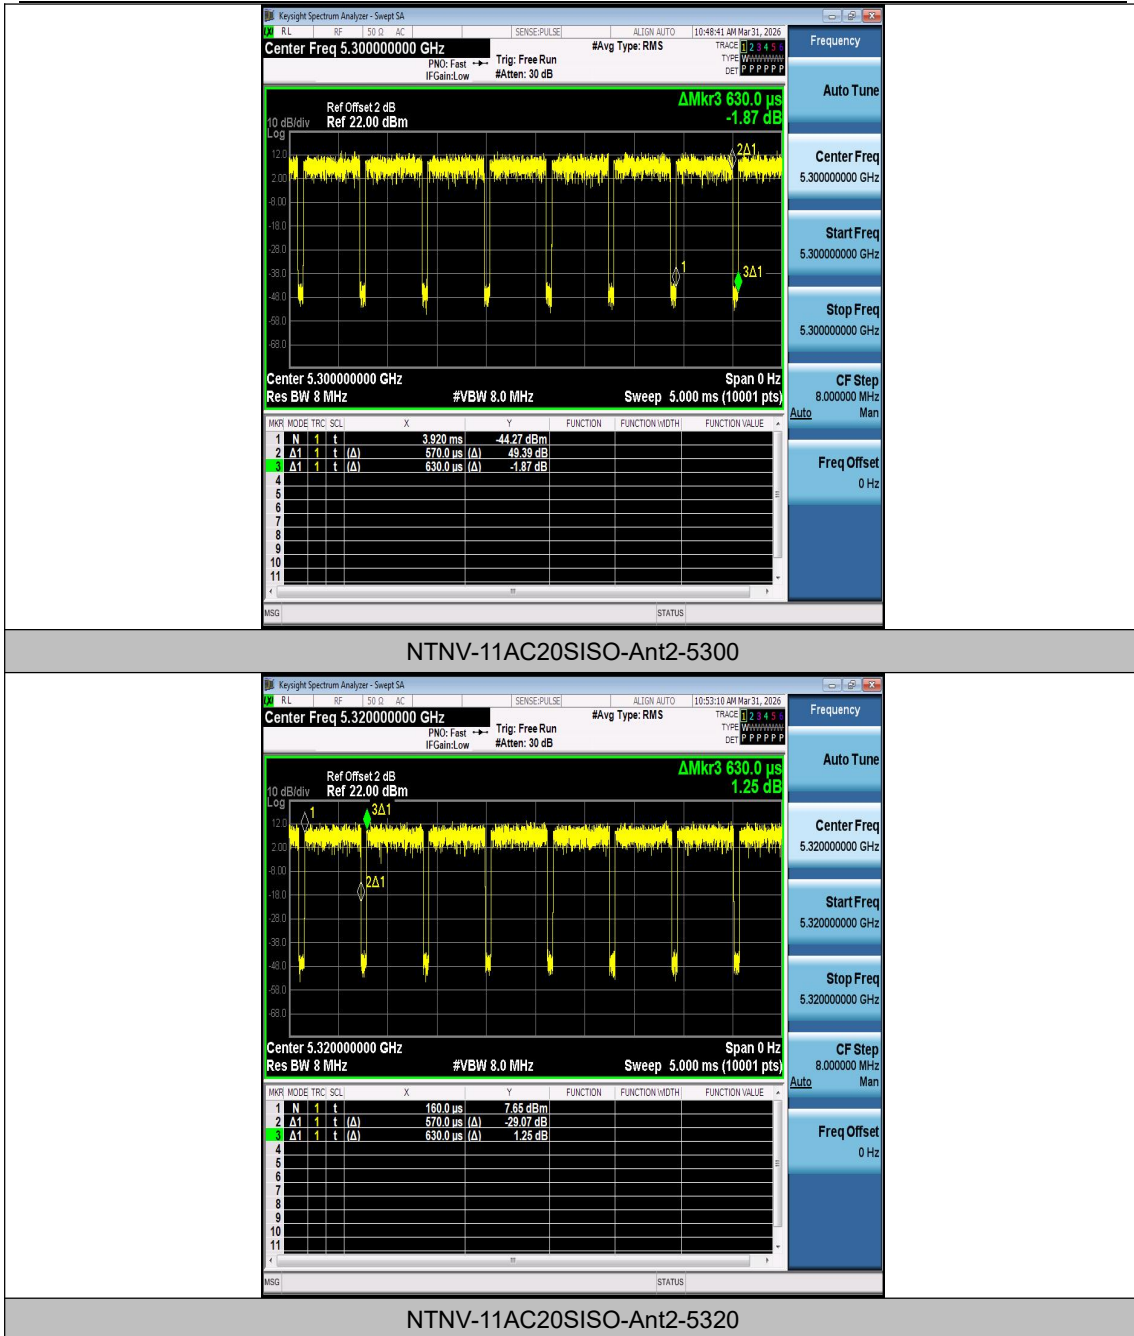

Appendix C: Maximum Conducted Output Power


Test Result Channel Power

Test Mode	Antenna	Frequency [MHz]	TPC type	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	TPC Limit [dBm]	Verdict
11A	Ant2	5180	NA	12.67	84.62	0.73	13.40	≤23.98	--	PASS
11A	Ant2	5220	NA	12.73	84.62	0.73	13.46	≤23.98	--	PASS
11A	Ant2	5240	NA	12.55	84.62	0.73	13.28	≤23.98	--	PASS
11A	Ant2	5260	NA	12.24	84.62	0.73	12.97	≤23.98	--	PASS
11A	Ant2	5260	TPC_H	13.46	84.62	0.73	14.19	≤23.98	--	PASS
11A	Ant2	5260	TPC_L	1.62	84.62	0.73	2.35	≤23.98	6	PASS
11A	Ant2	5300	NA	12.17	84.62	0.73	12.90	≤23.98	--	PASS
11A	Ant2	5300	TPC_H	13.59	84.62	0.73	14.32	≤23.98	--	PASS
11A	Ant2	5300	TPC_L	2.12	84.62	0.73	2.85	≤23.98	6	PASS
11A	Ant2	5320	NA	11.78	84.21	0.75	12.53	≤23.98	--	PASS
11A	Ant2	5320	TPC_H	13.51	84.21	0.75	14.26	≤23.98	--	PASS
11A	Ant2	5320	TPC_L	2.35	84.21	0.75	3.10	≤23.98	6	PASS
11N20SI SO	Ant2	5180	NA	12.85	88.68	0.52	13.37	≤23.98	--	PASS
11N20SI SO	Ant2	5220	NA	12.80	88.46	0.53	13.33	≤23.98	--	PASS
11N20SI SO	Ant2	5240	NA	12.50	88.46	0.53	13.03	≤23.98	--	PASS
11N20SI SO	Ant2	5260	NA	11.99	88.46	0.53	12.52	≤23.98	--	PASS
11N20SI SO	Ant2	5260	TPC_H	13.90	88.46	0.53	14.43	≤23.98	--	PASS
11N20SI SO	Ant2	5260	TPC_L	2.68	88.46	0.53	3.21	≤23.98	6	PASS
11N20SI SO	Ant2	5300	NA	12.10	88.46	0.53	12.63	≤23.98	--	PASS
11N20SI SO	Ant2	5300	TPC_H	13.85	88.46	0.53	14.38	≤23.98	--	PASS
11N20SI SO	Ant2	5300	TPC_L	2.90	88.46	0.53	3.43	≤23.98	6	PASS
11N20SI SO	Ant2	5320	NA	11.87	88.46	0.53	12.40	≤23.98	--	PASS
11N20SI SO	Ant2	5320	TPC_H	13.53	88.46	0.53	14.06	≤23.98	--	PASS

11N20SI SO	Ant2	5320	TPC_L	2.94	88.46	0.53	3.47	≤23.98	6	PASS
11AC20S ISO	Ant2	5180	NA	12.93	90.48	0.43	13.36	≤23.98	--	PASS
11AC20S ISO	Ant2	5220	NA	12.73	90.48	0.43	13.16	≤23.98	--	PASS
11AC20S ISO	Ant2	5240	NA	12.81	90.48	0.43	13.24	≤23.98	--	PASS
11AC20S ISO	Ant2	5260	NA	12.40	90.48	0.43	12.83	≤23.98	--	PASS
11AC20S ISO	Ant2	5260	TPC_H	13.96	90.48	0.43	14.39	≤23.98	--	PASS
11AC20S ISO	Ant2	5260	TPC_L	2.65	90.48	0.43	3.08	≤23.98	6	PASS
11AC20S ISO	Ant2	5300	NA	12.22	90.48	0.43	12.65	≤23.98	--	PASS
11AC20S ISO	Ant2	5300	TPC_H	13.80	90.48	0.43	14.23	≤23.98	--	PASS
11AC20S ISO	Ant2	5300	TPC_L	2.94	90.48	0.43	3.37	≤23.98	6	PASS
11AC20S ISO	Ant2	5320	NA	12.03	90.48	0.43	12.46	≤23.98	--	PASS
11AC20S ISO	Ant2	5320	TPC_H	13.71	90.48	0.43	14.14	≤23.98	--	PASS
11AC20S ISO	Ant2	5320	TPC_L	2.91	90.48	0.43	3.34	≤23.98	6	PASS

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.


Test Graphs Channel Power

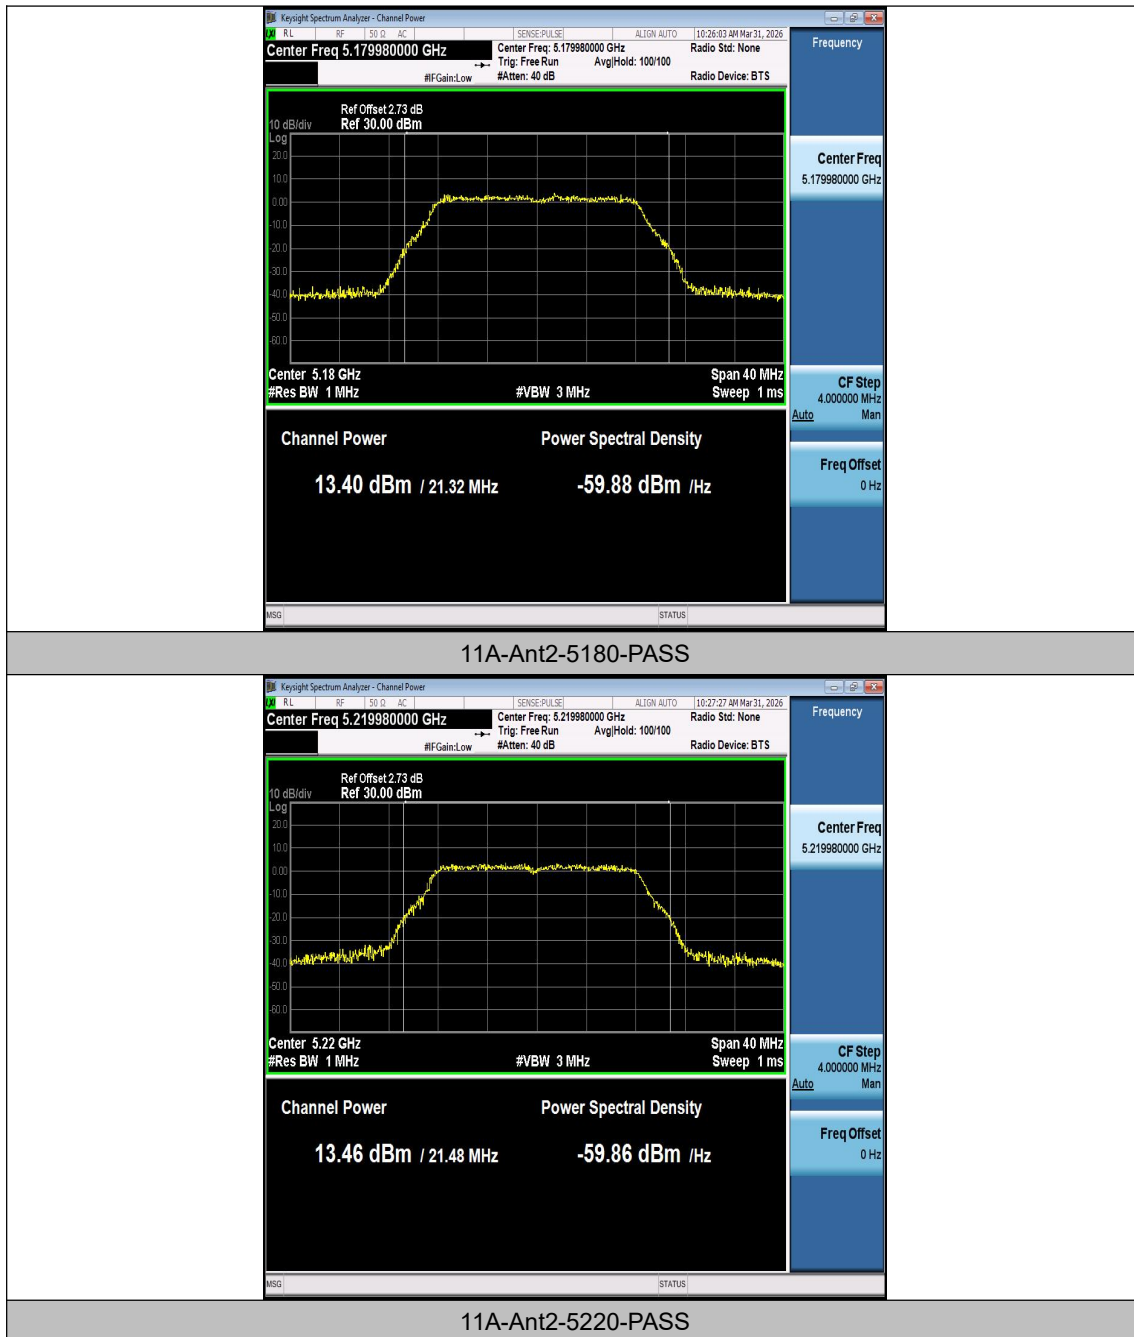

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

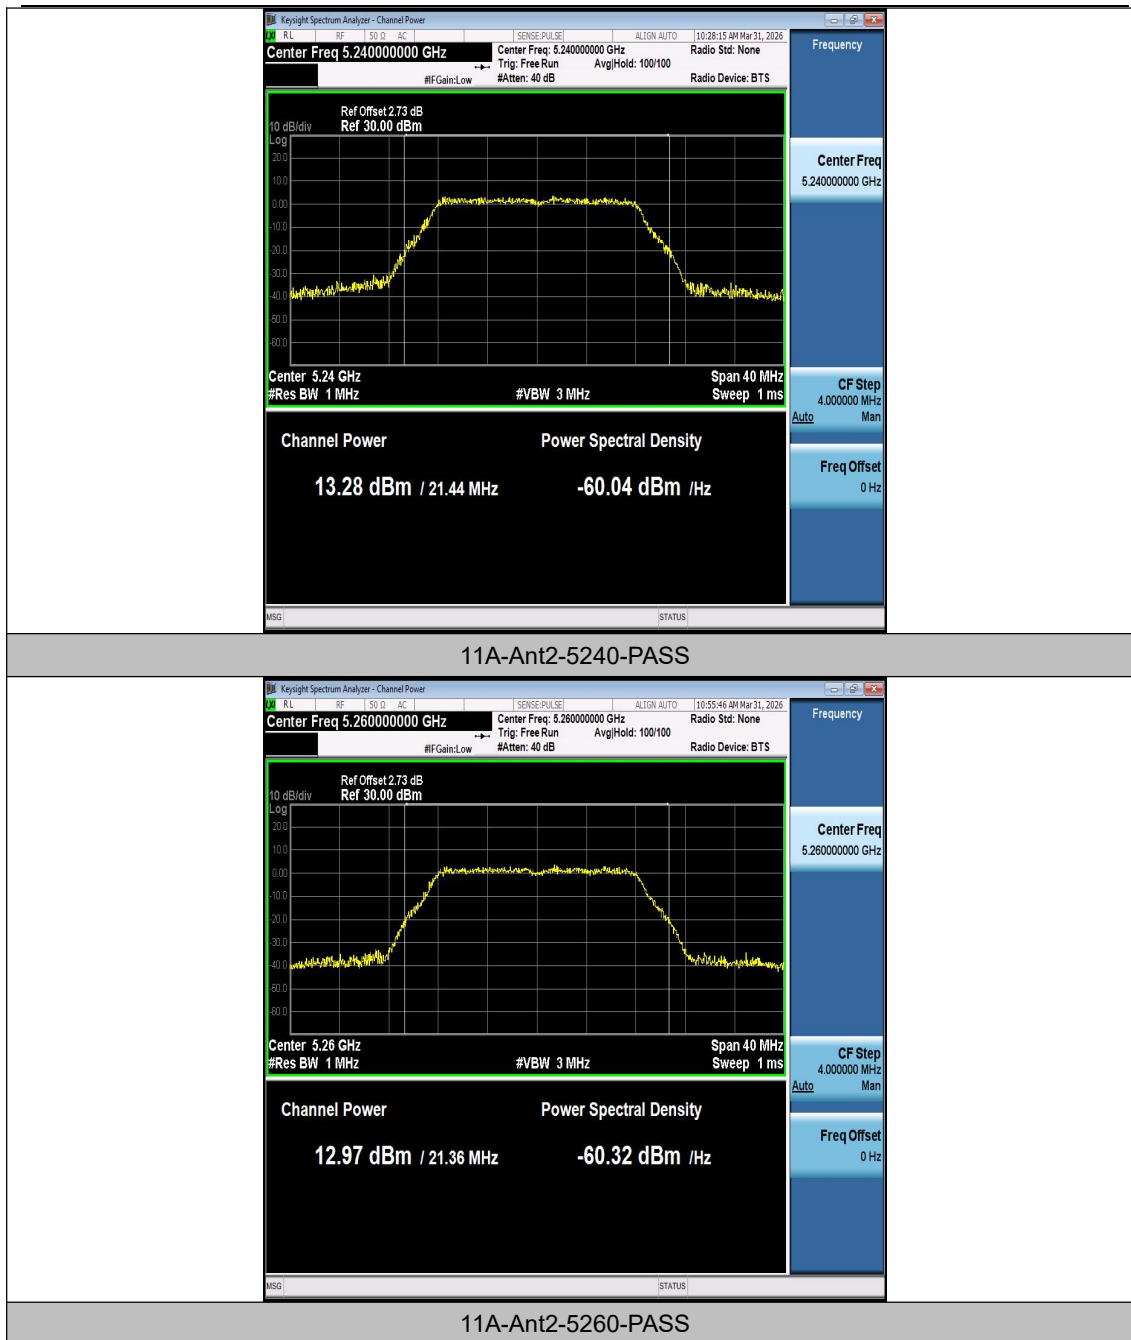


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

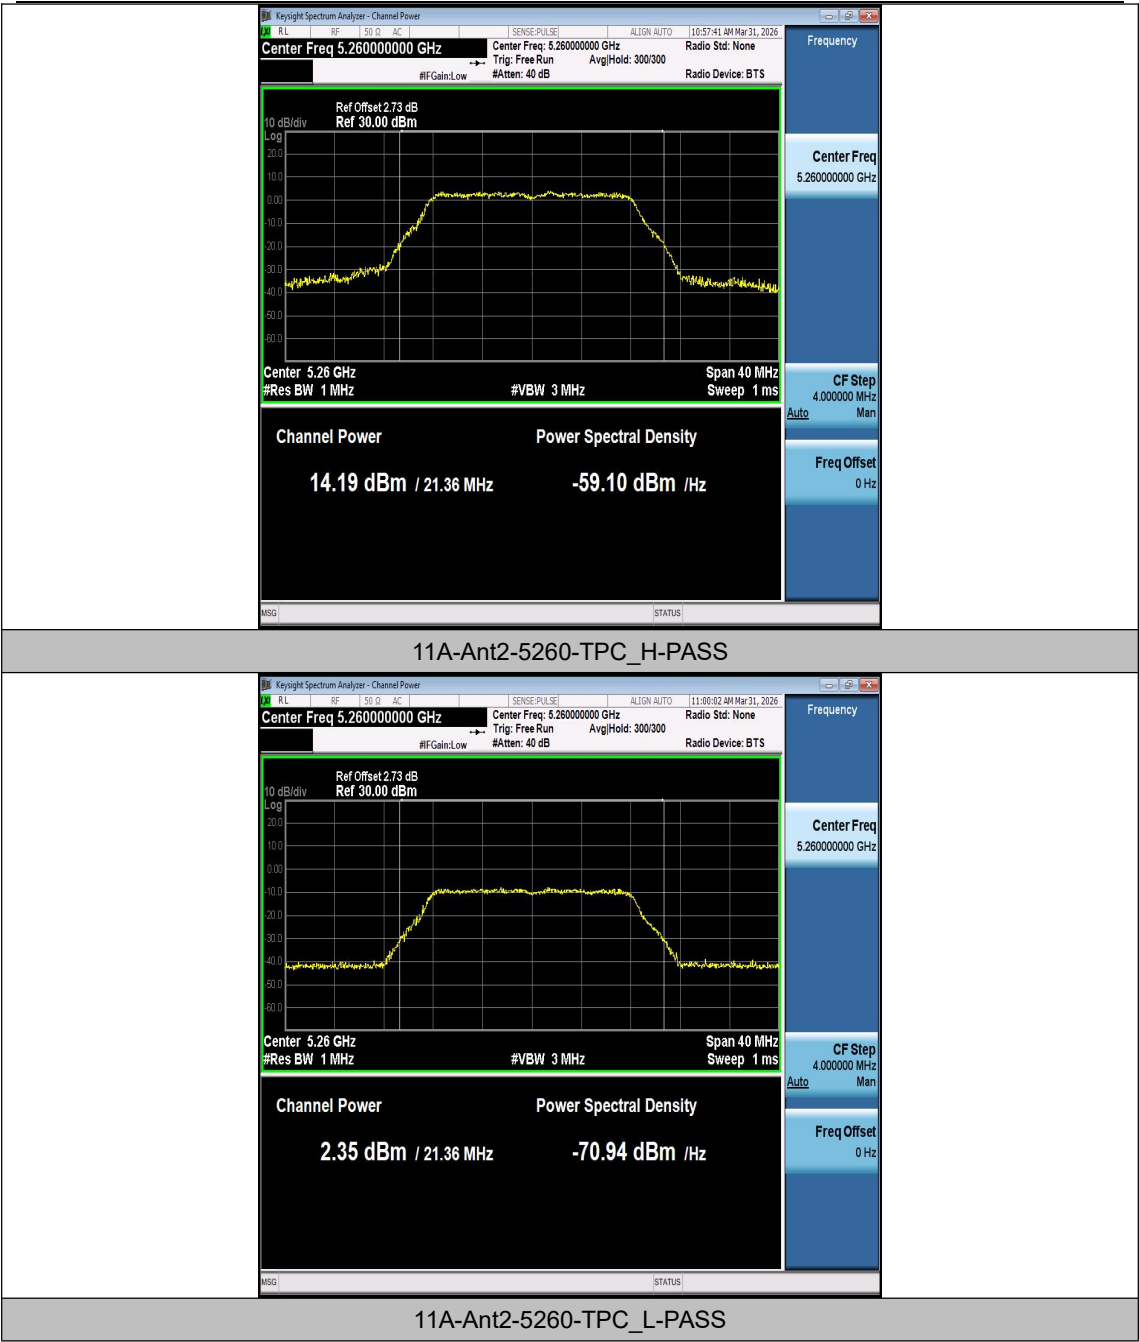


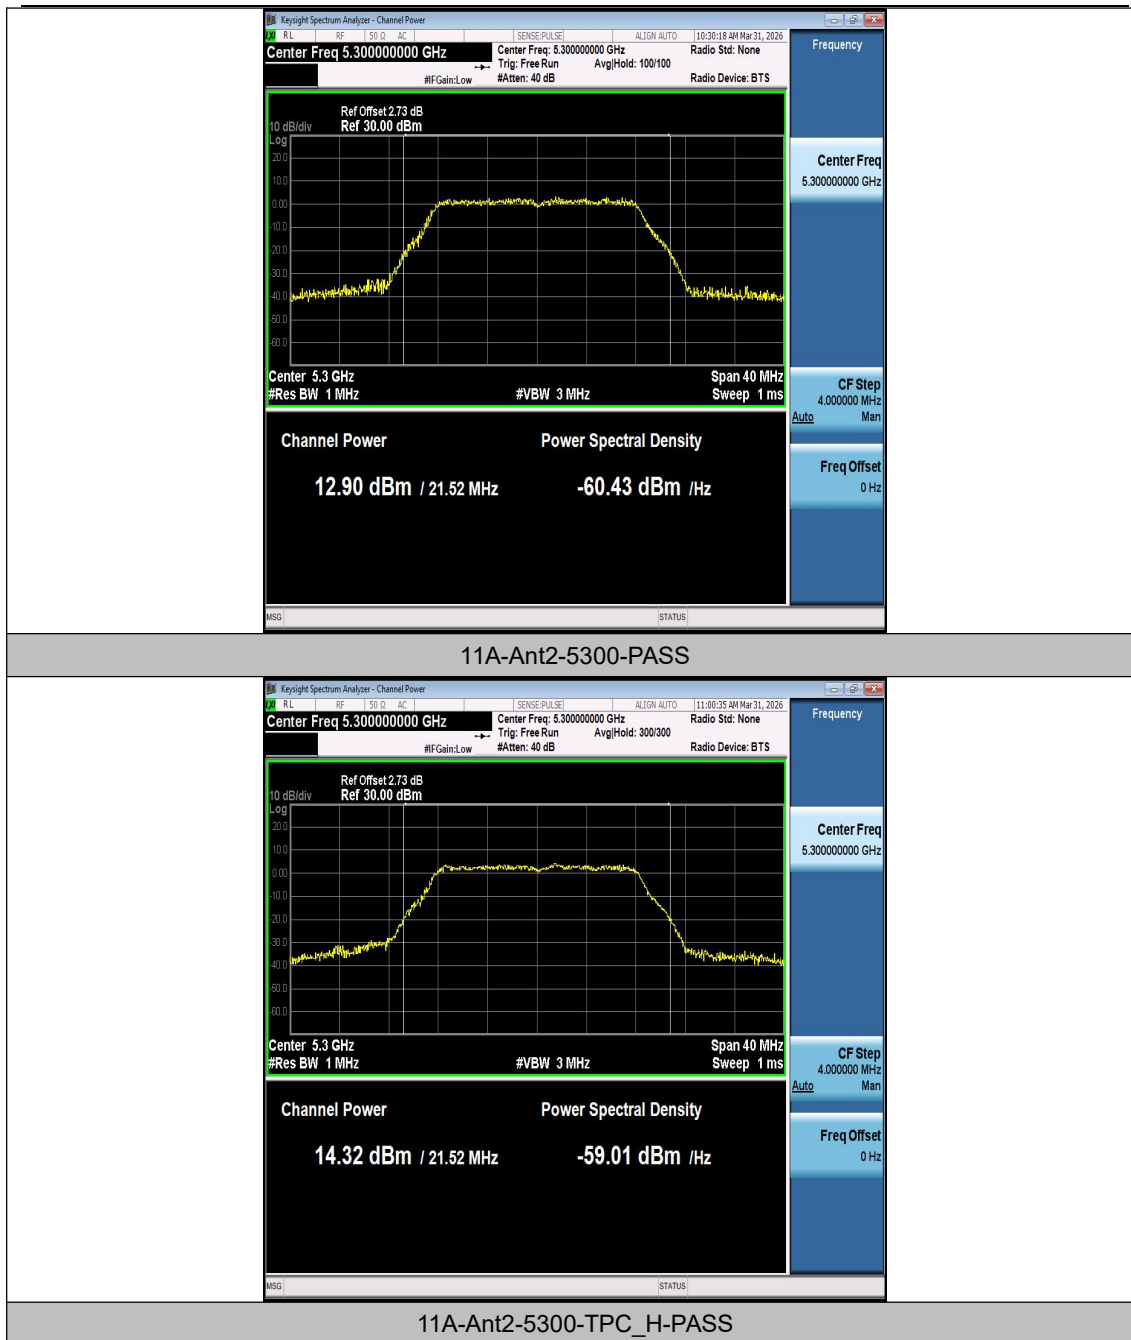

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

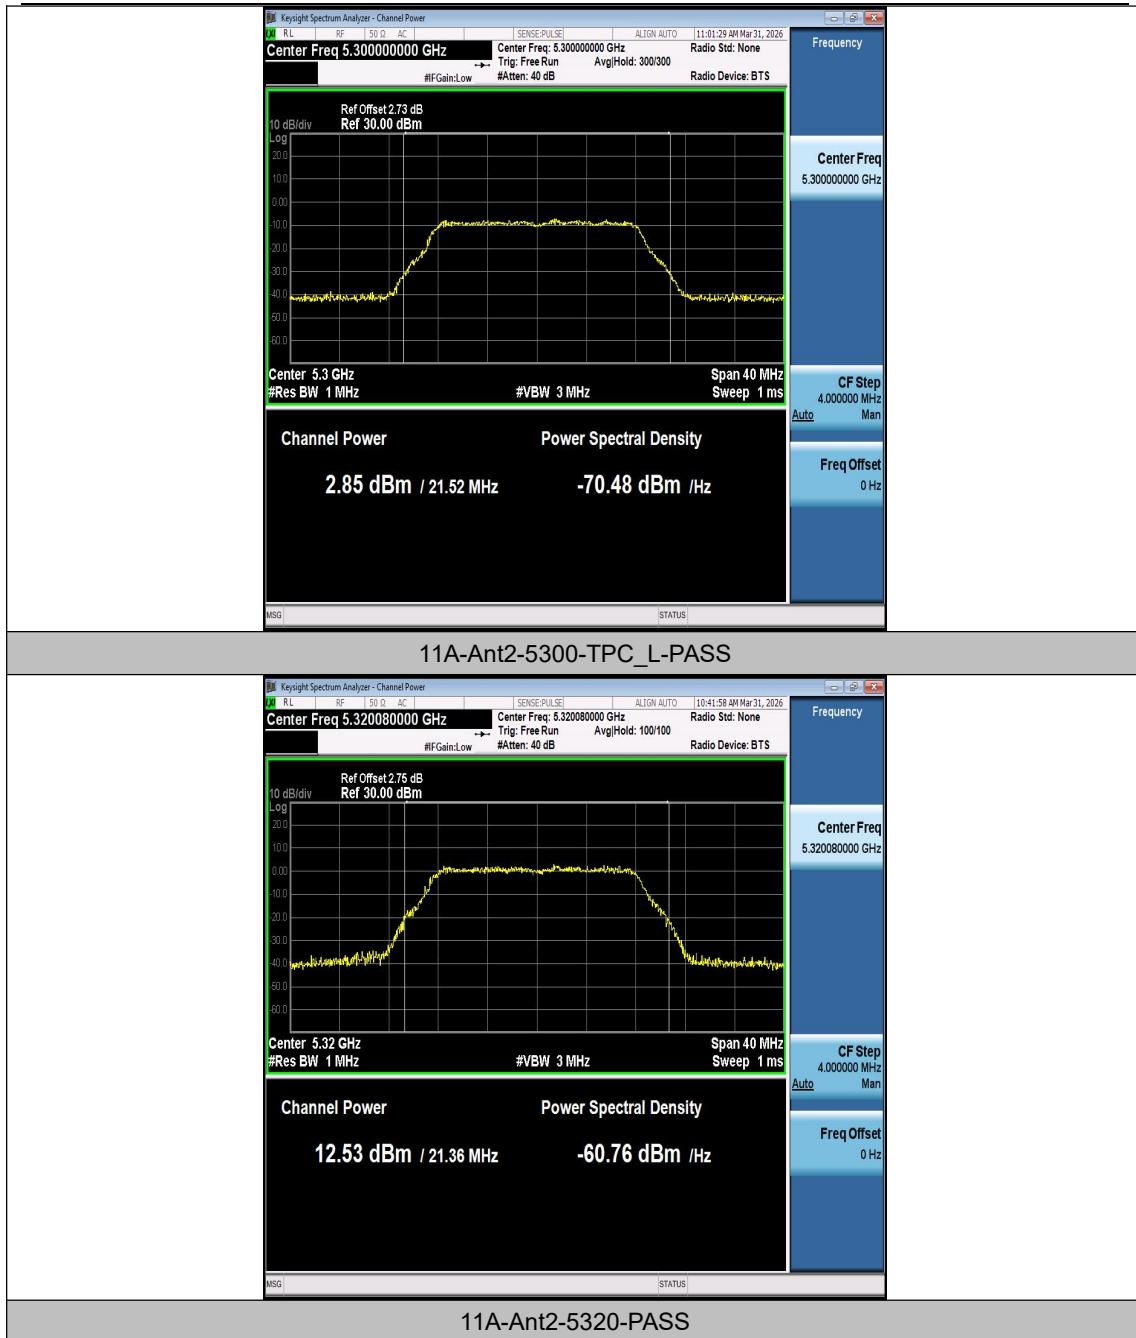


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

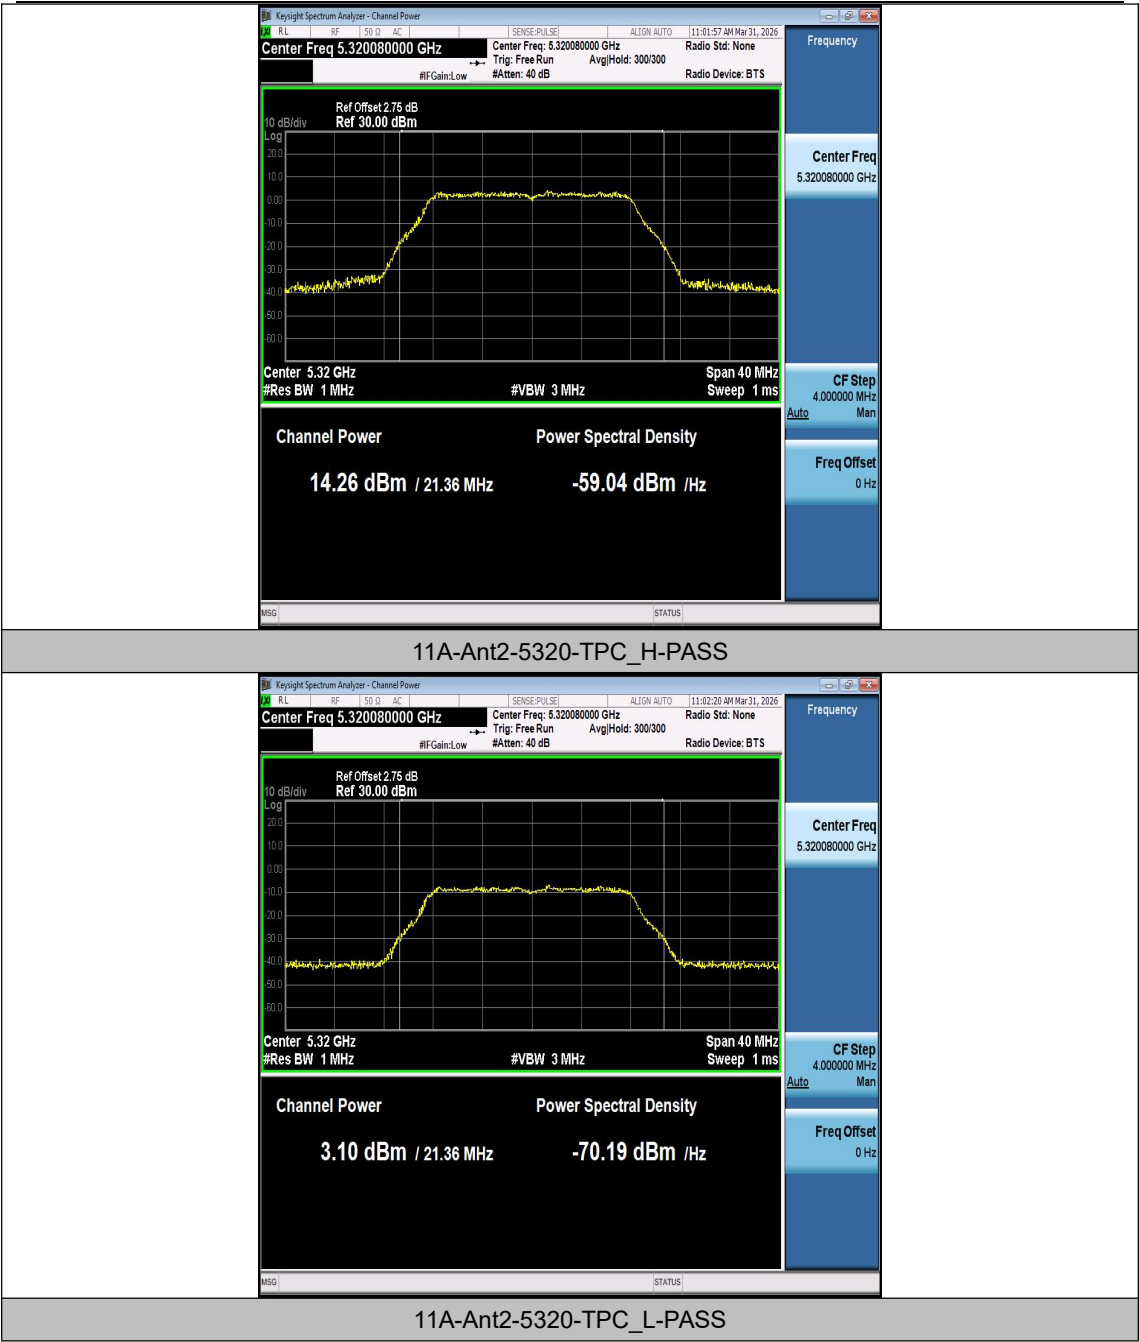


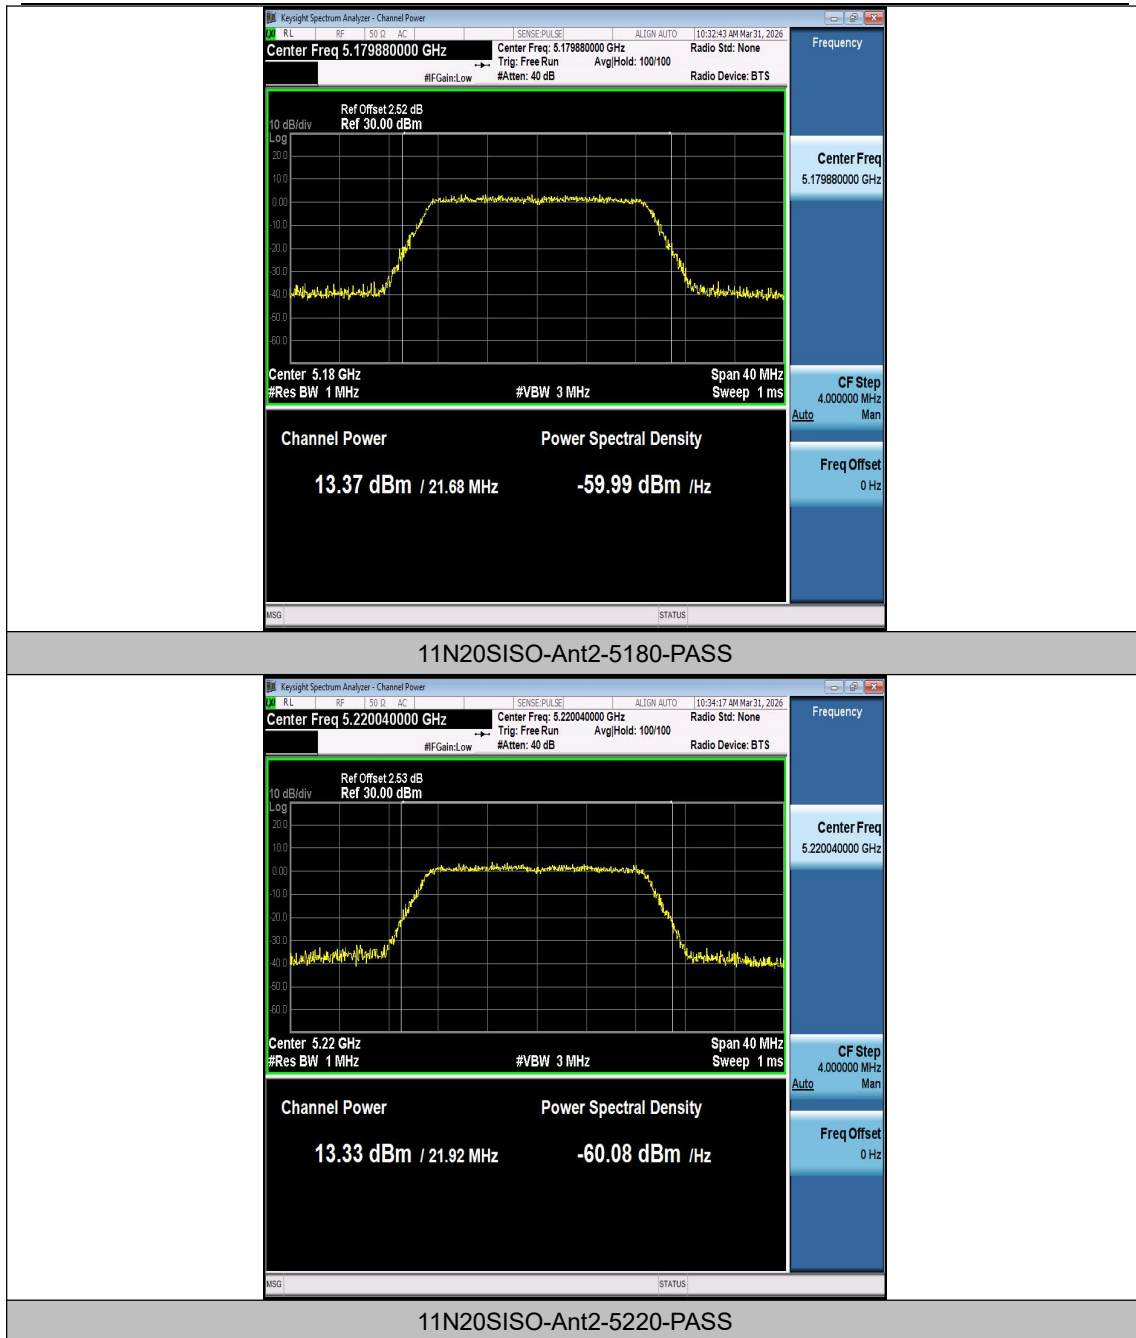

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

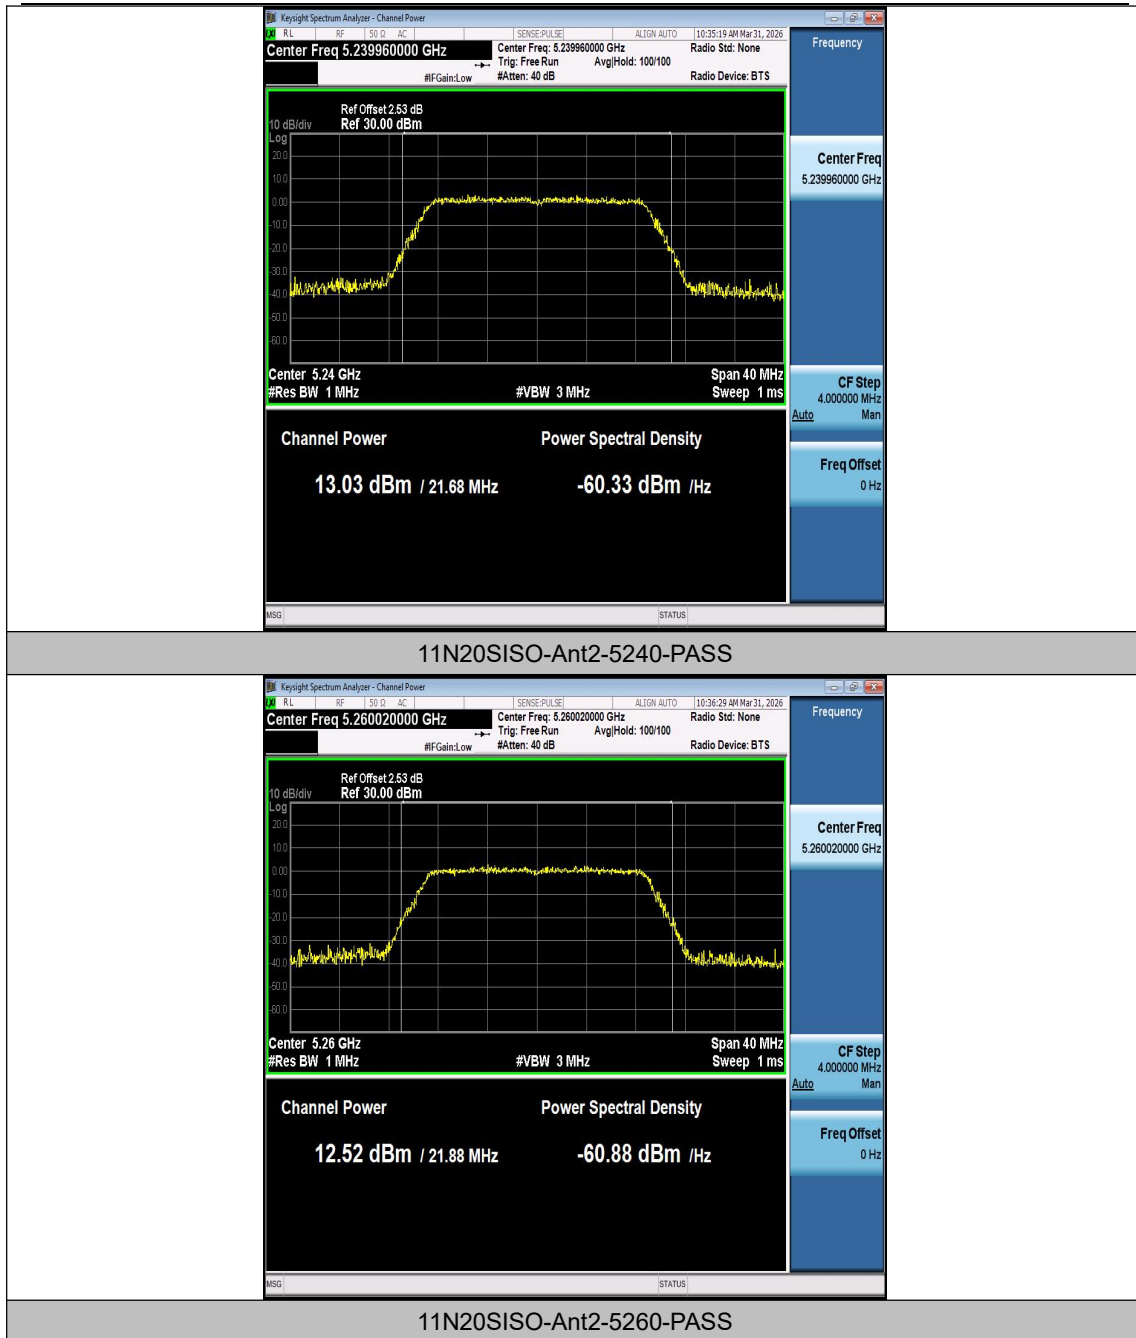

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

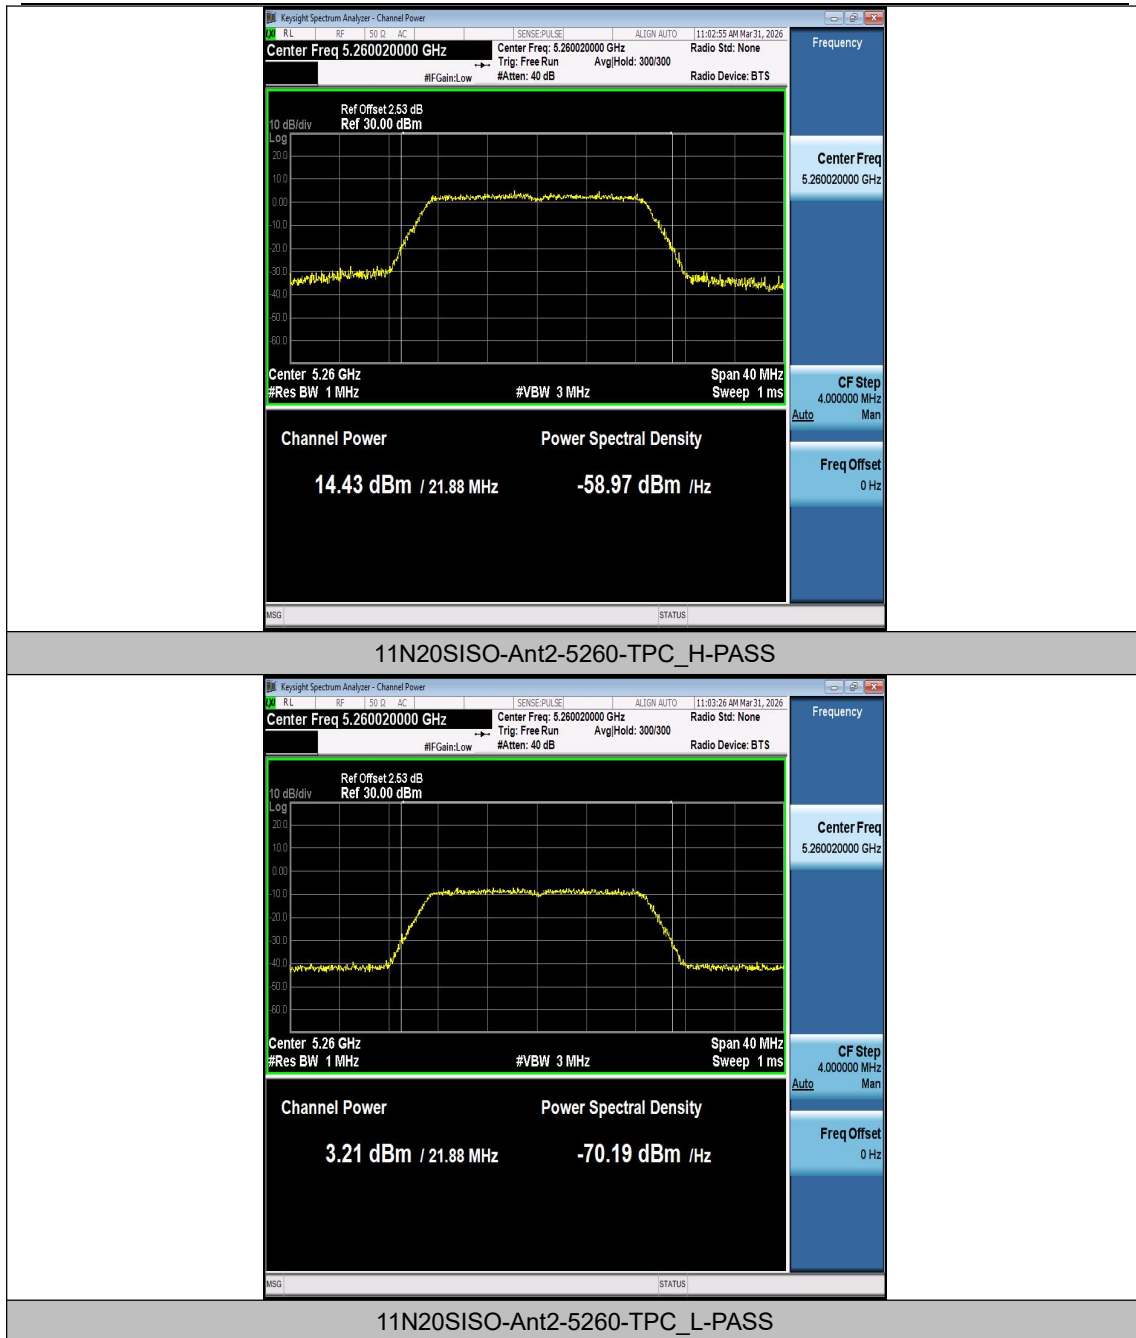


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

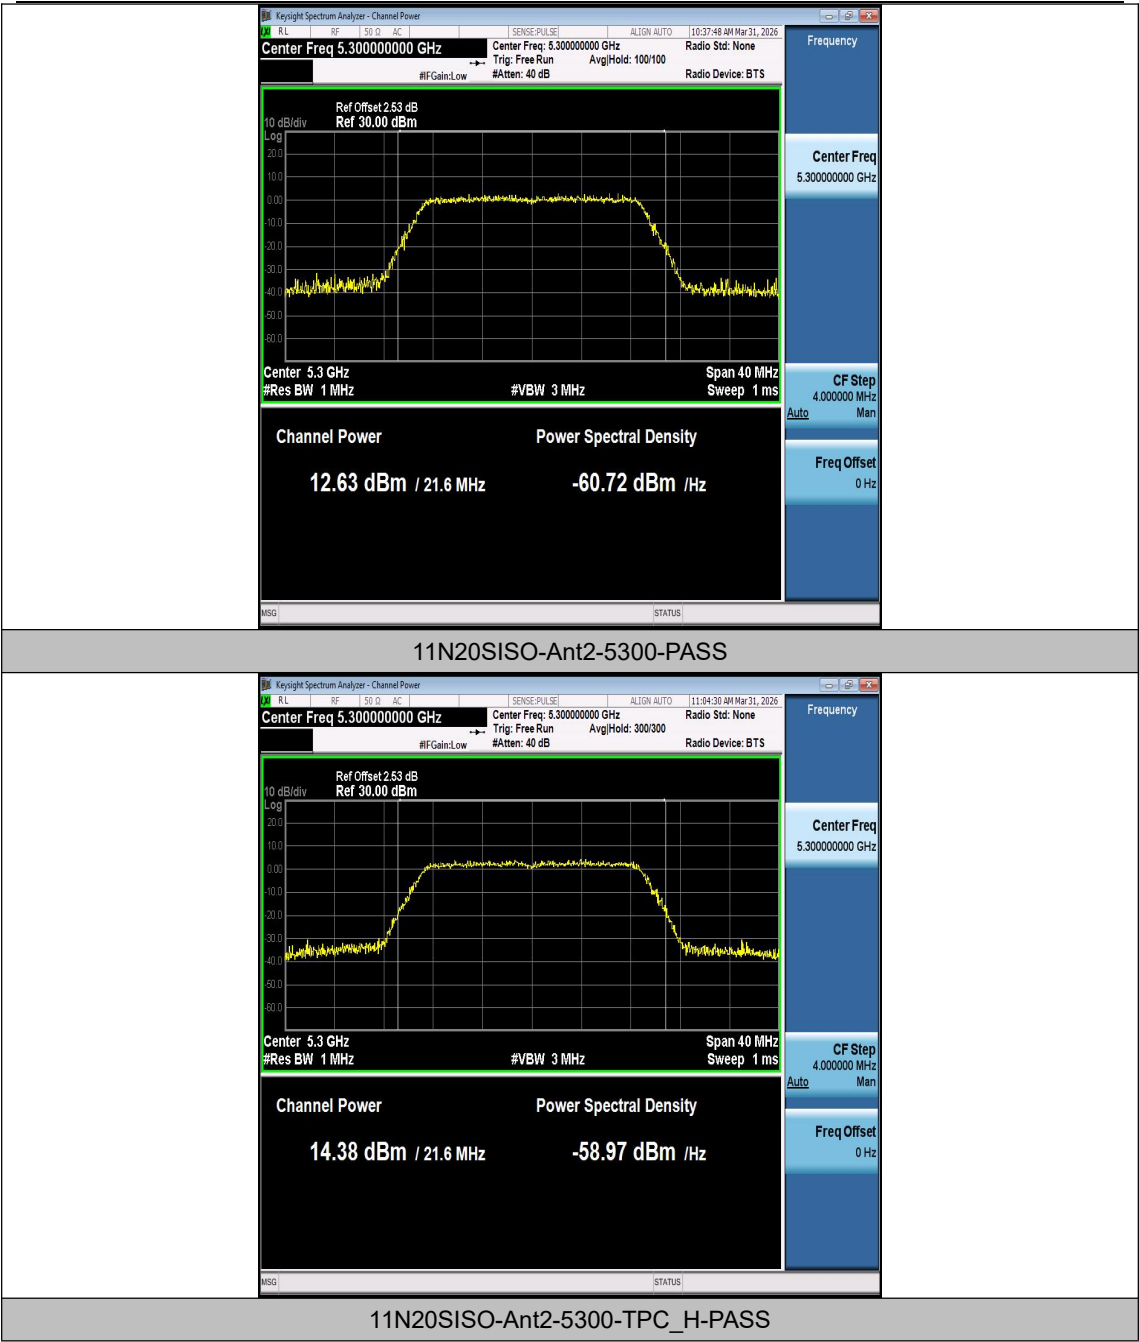

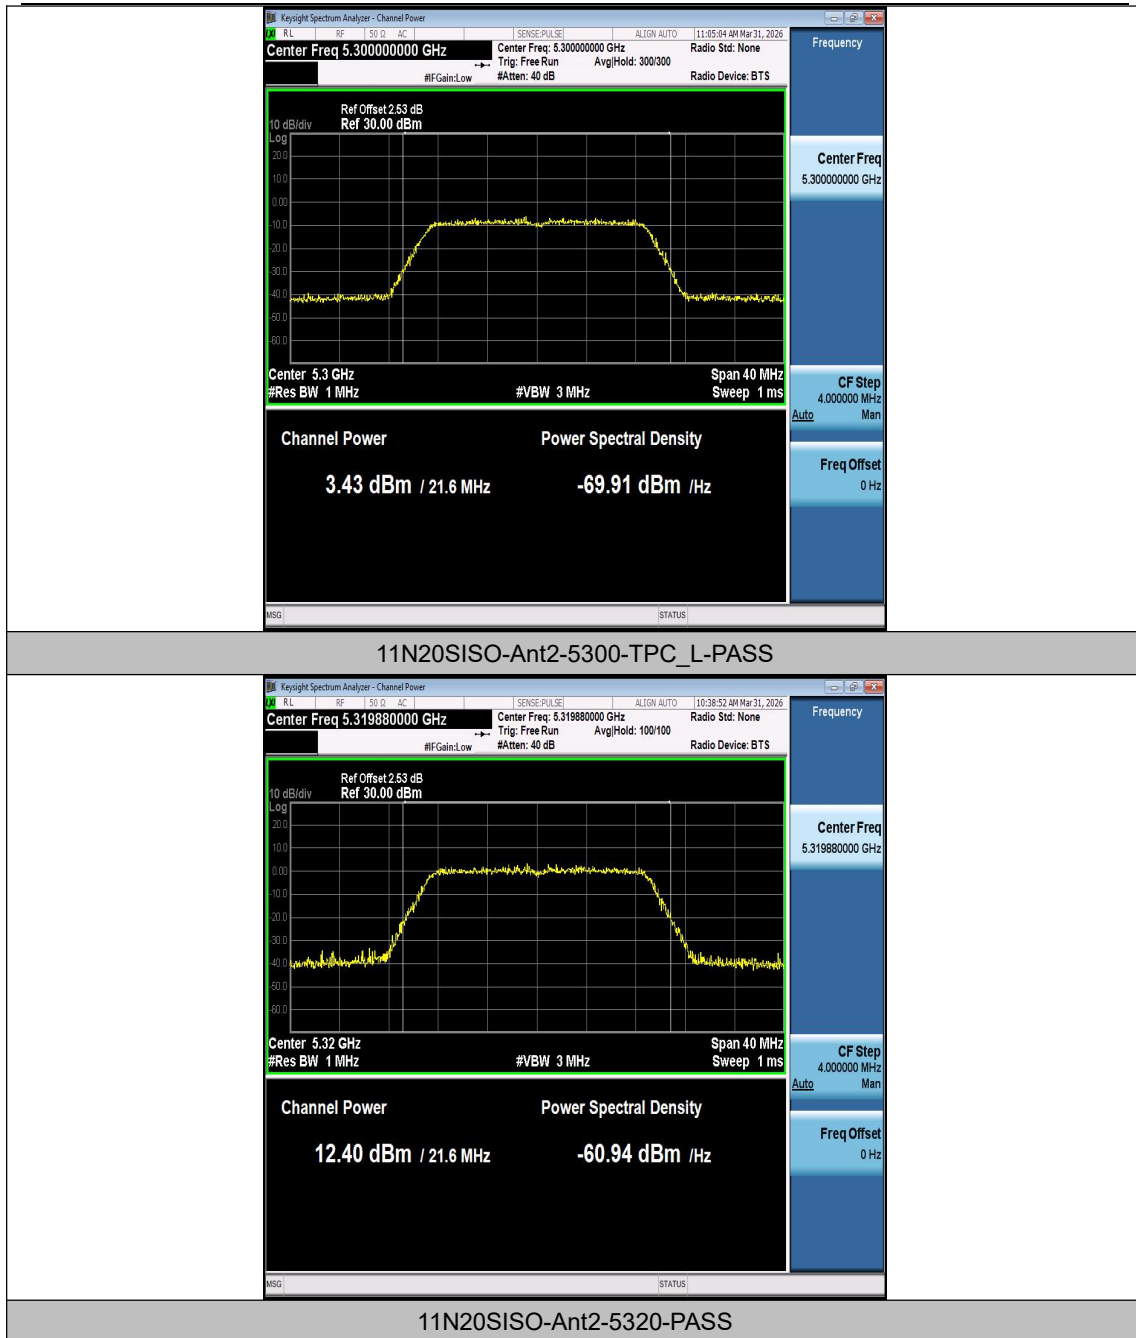

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

