



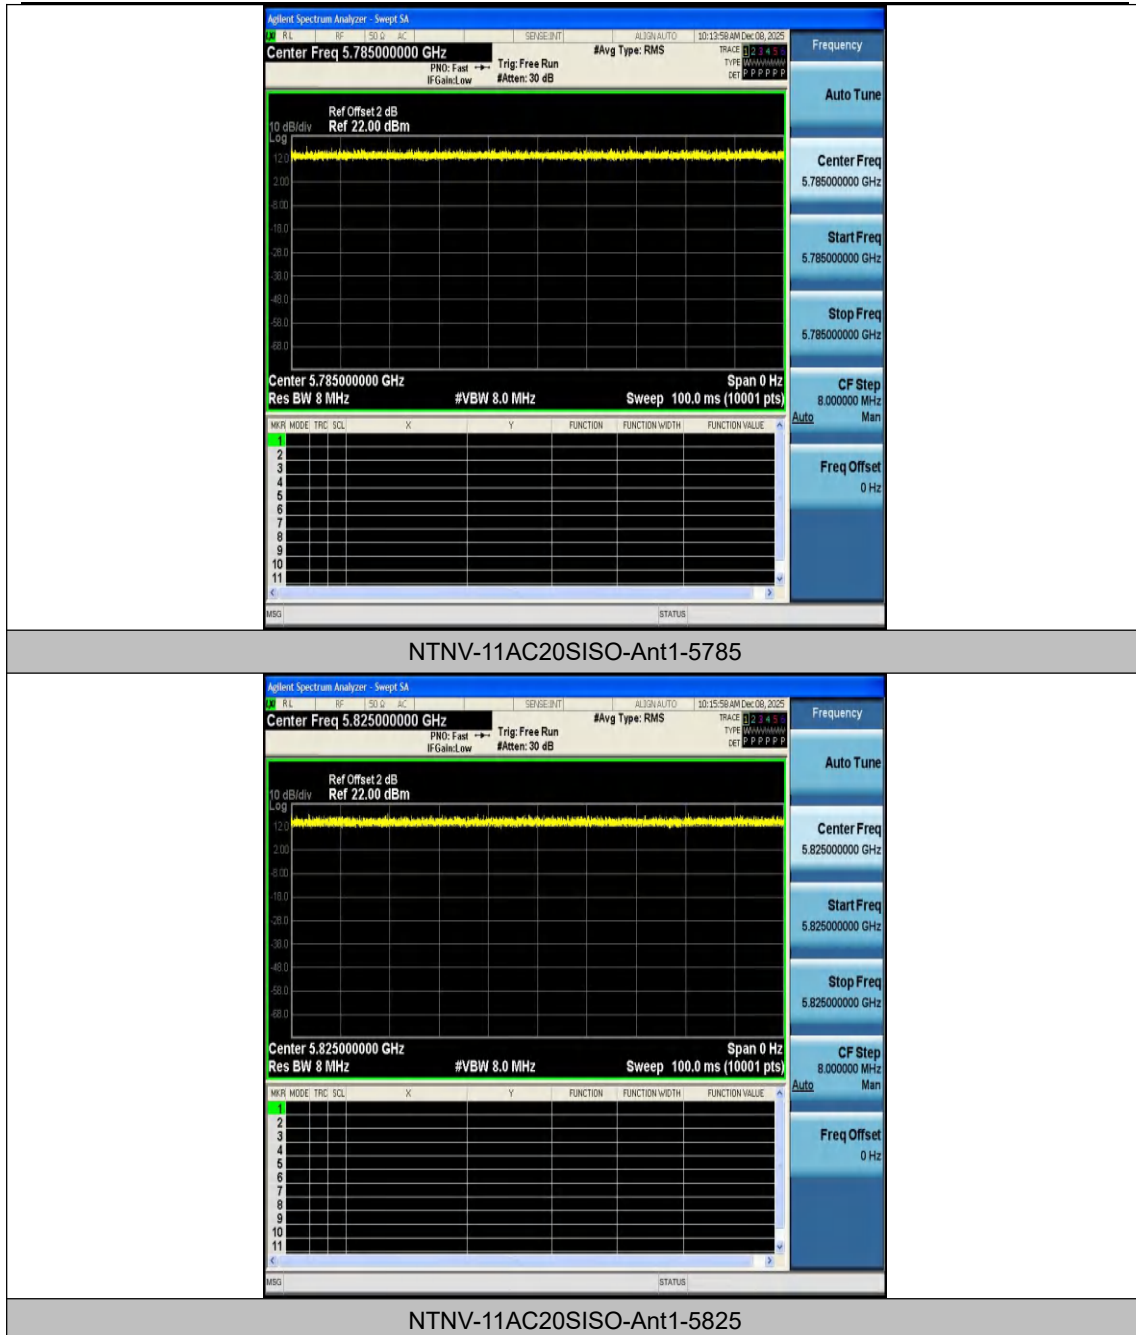


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

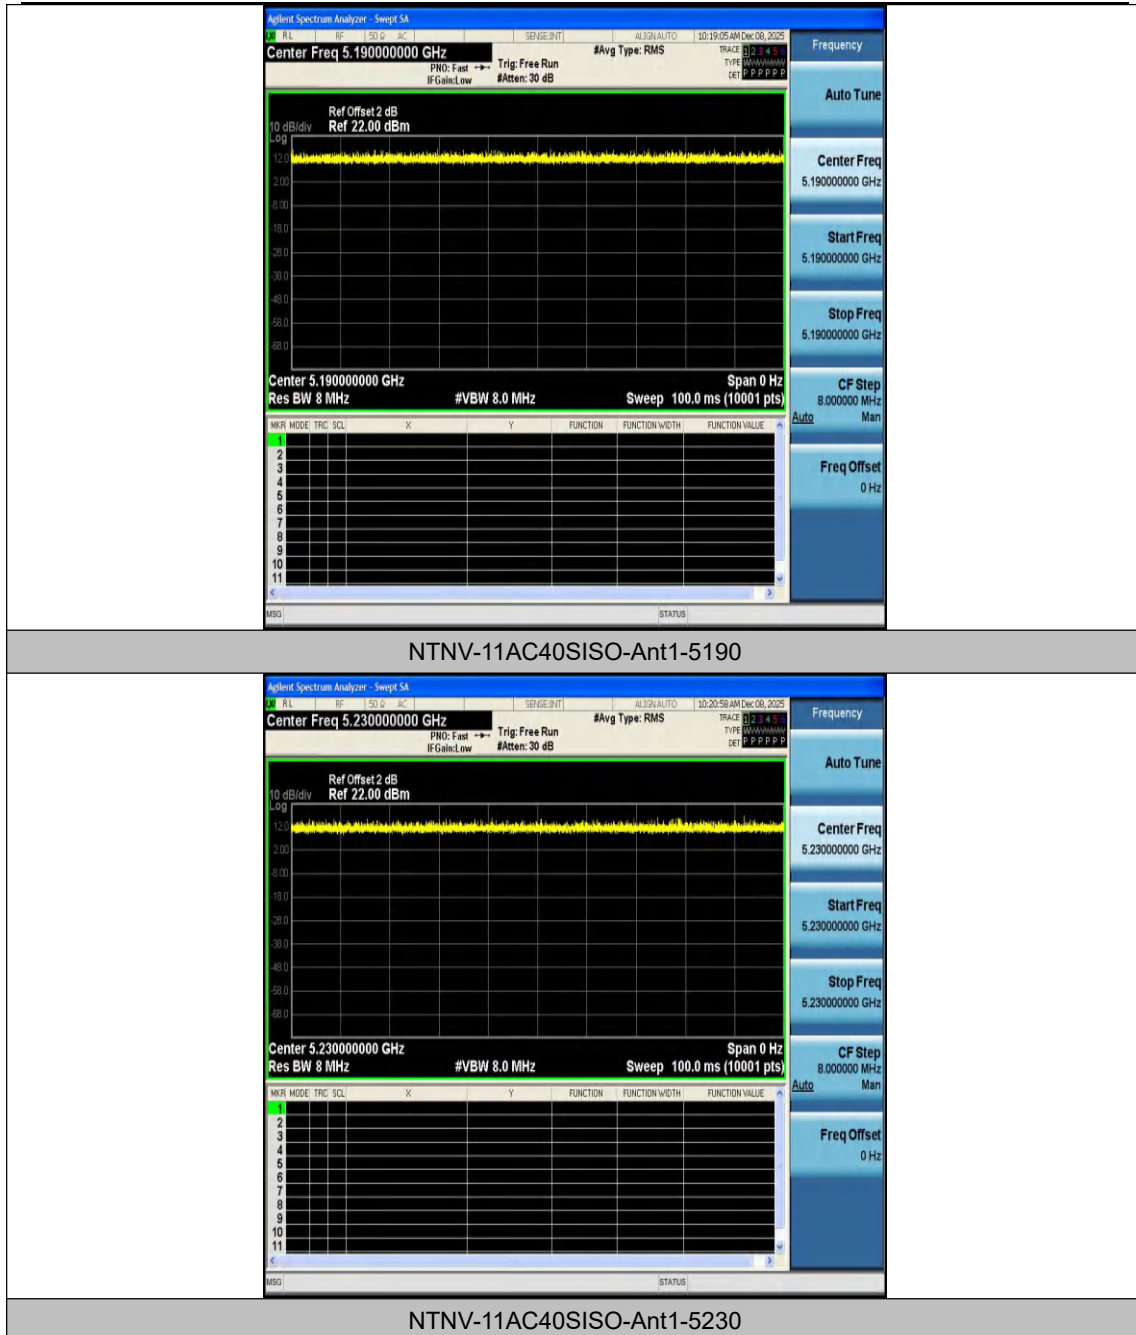


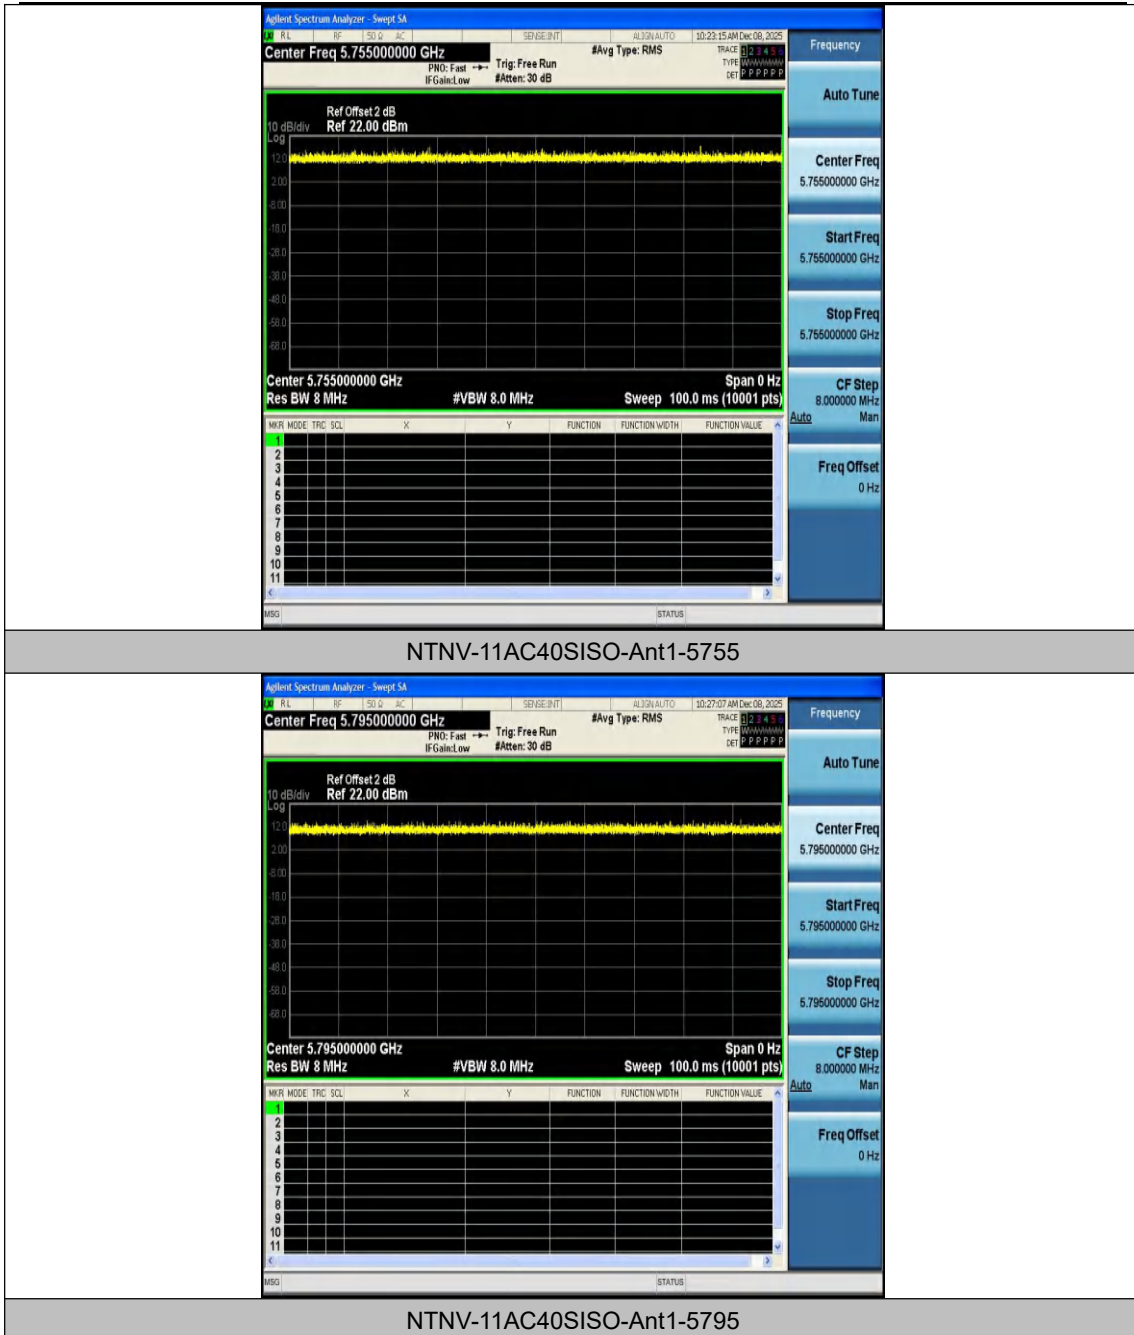

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

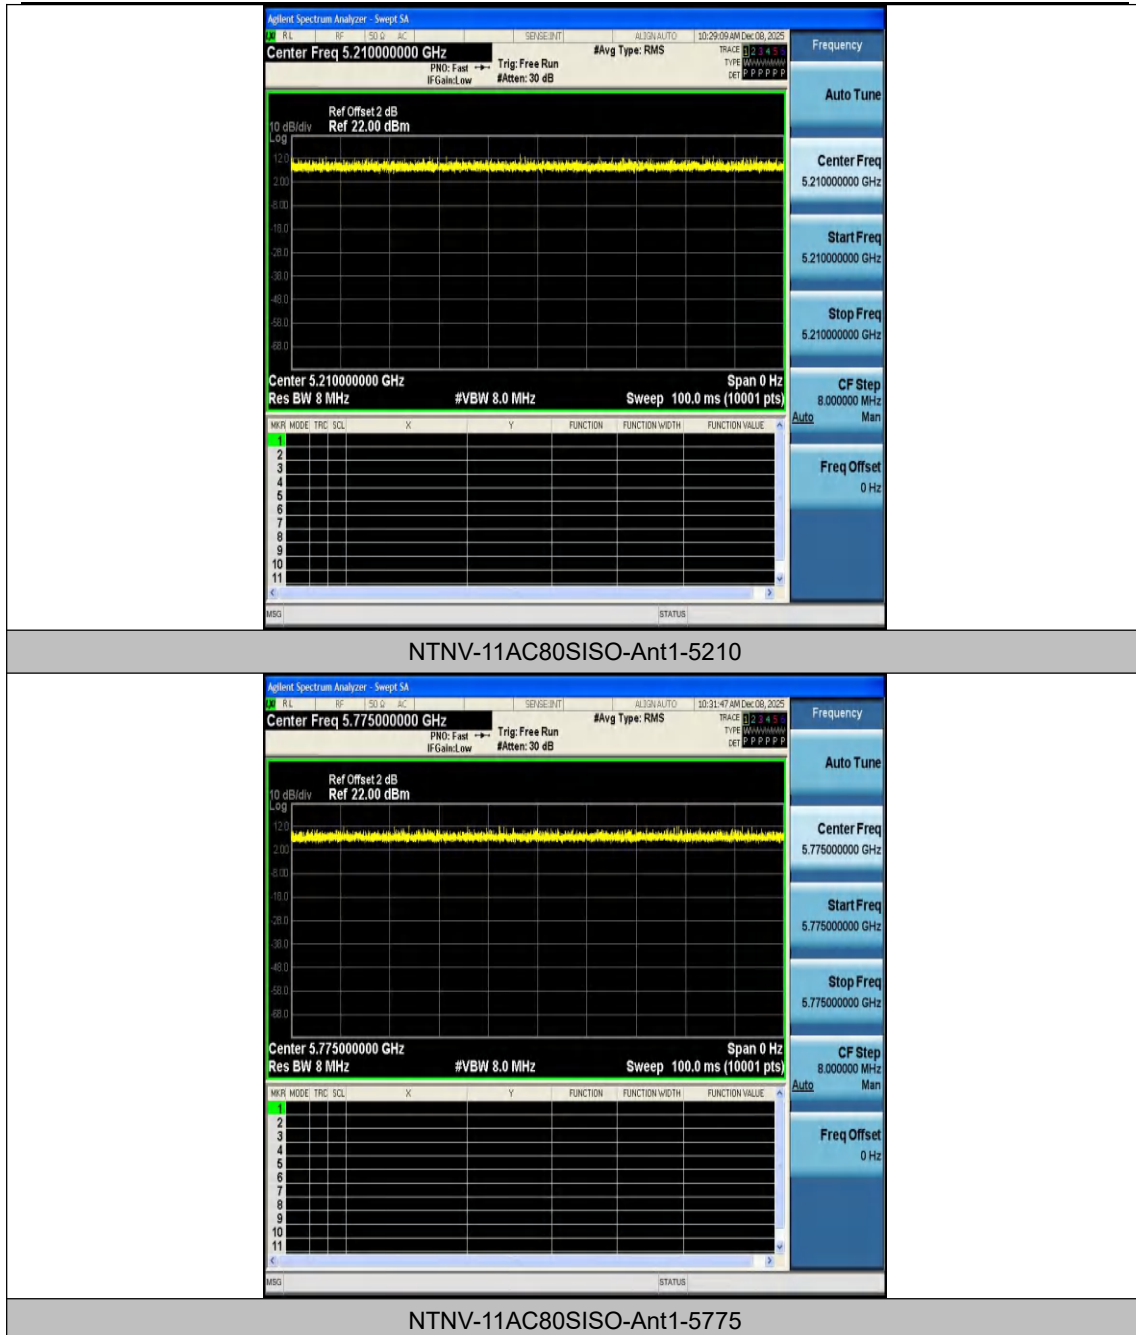

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	14.31	≤23.98	PASS
11A	Ant1	5220	14.56	≤23.98	PASS
11A	Ant1	5240	13.87	≤23.98	PASS
11A	Ant1	5745	15.62	≤30.00	PASS
11A	Ant1	5785	13.48	≤30.00	PASS
11A	Ant1	5825	14.22	≤30.00	PASS
11N20SISO	Ant1	5180	14.21	≤23.98	PASS
11N20SISO	Ant1	5220	14.37	≤23.98	PASS
11N20SISO	Ant1	5240	13.69	≤23.98	PASS
11N20SISO	Ant1	5745	15.56	≤30.00	PASS
11N20SISO	Ant1	5785	13.33	≤30.00	PASS
11N20SISO	Ant1	5825	14.05	≤30.00	PASS
11N40SISO	Ant1	5190	14.44	≤23.98	PASS
11N40SISO	Ant1	5230	14.04	≤23.98	PASS
11N40SISO	Ant1	5755	14.90	≤30.00	PASS
11N40SISO	Ant1	5795	13.61	≤30.00	PASS
11AC20SISO	Ant1	5180	14.35	≤23.98	PASS
11AC20SISO	Ant1	5220	14.42	≤23.98	PASS
11AC20SISO	Ant1	5240	13.80	≤23.98	PASS
11AC20SISO	Ant1	5745	15.40	≤30.00	PASS
11AC20SISO	Ant1	5785	13.55	≤30.00	PASS
11AC20SISO	Ant1	5825	14.06	≤30.00	PASS
11AC40SISO	Ant1	5190	14.63	≤23.98	PASS
11AC40SISO	Ant1	5230	14.06	≤23.98	PASS
11AC40SISO	Ant1	5755	15.18	≤30.00	PASS
11AC40SISO	Ant1	5795	13.71	≤30.00	PASS
11AC80SISO	Ant1	5210	14.51	≤23.98	PASS
11AC80SISO	Ant1	5775	14.31	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.


Test Graphs Channel Power

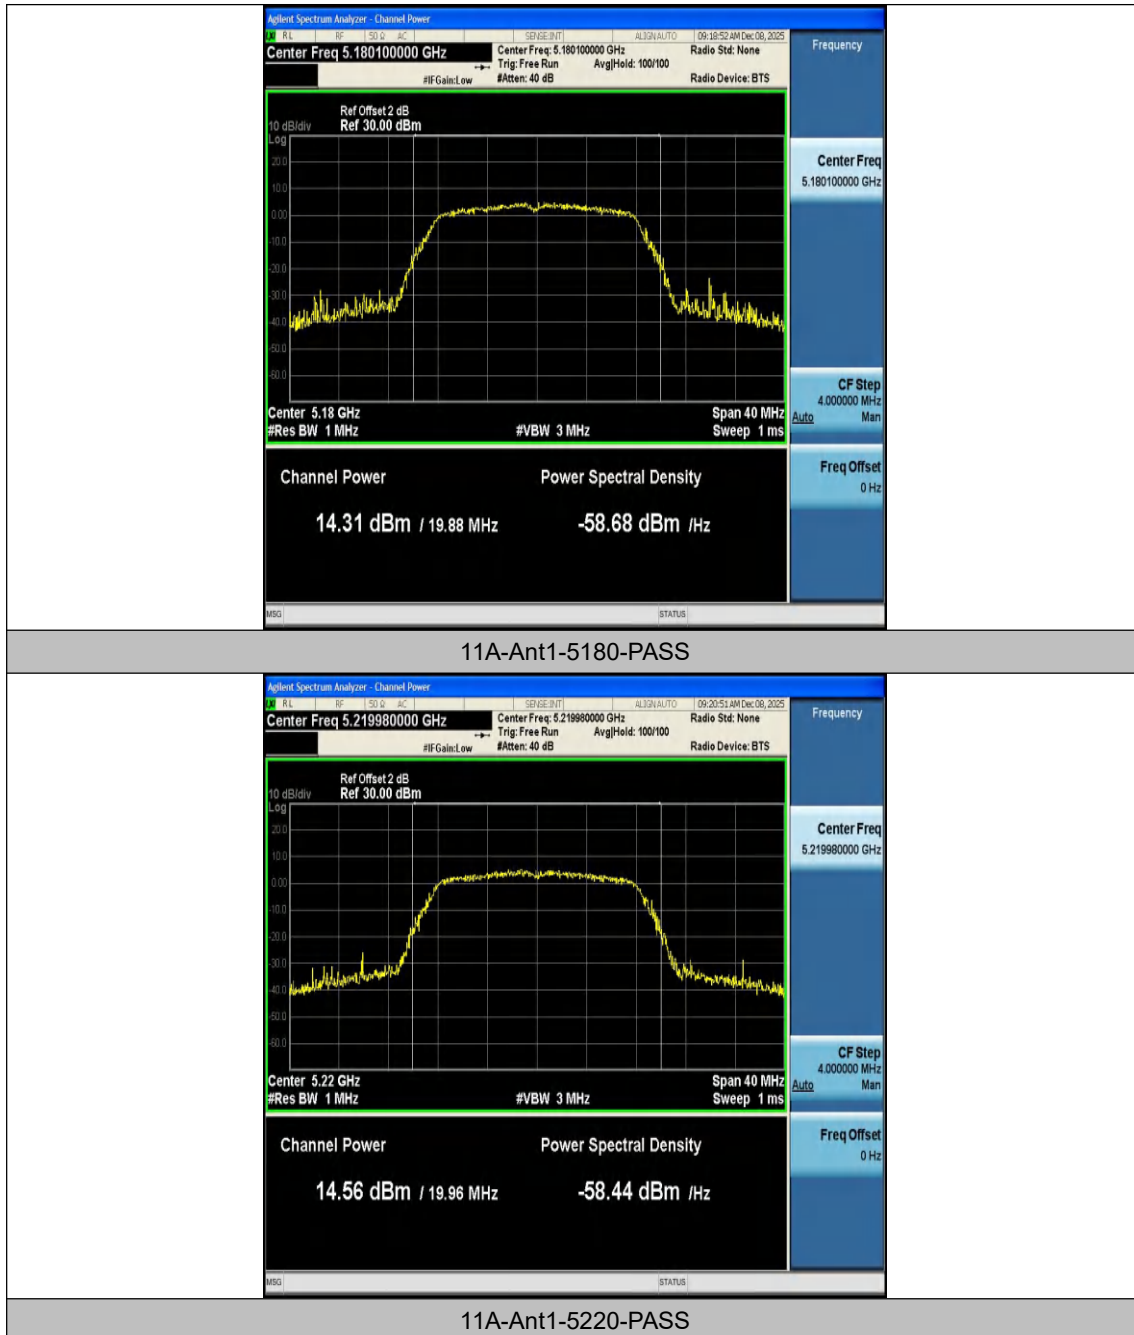


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

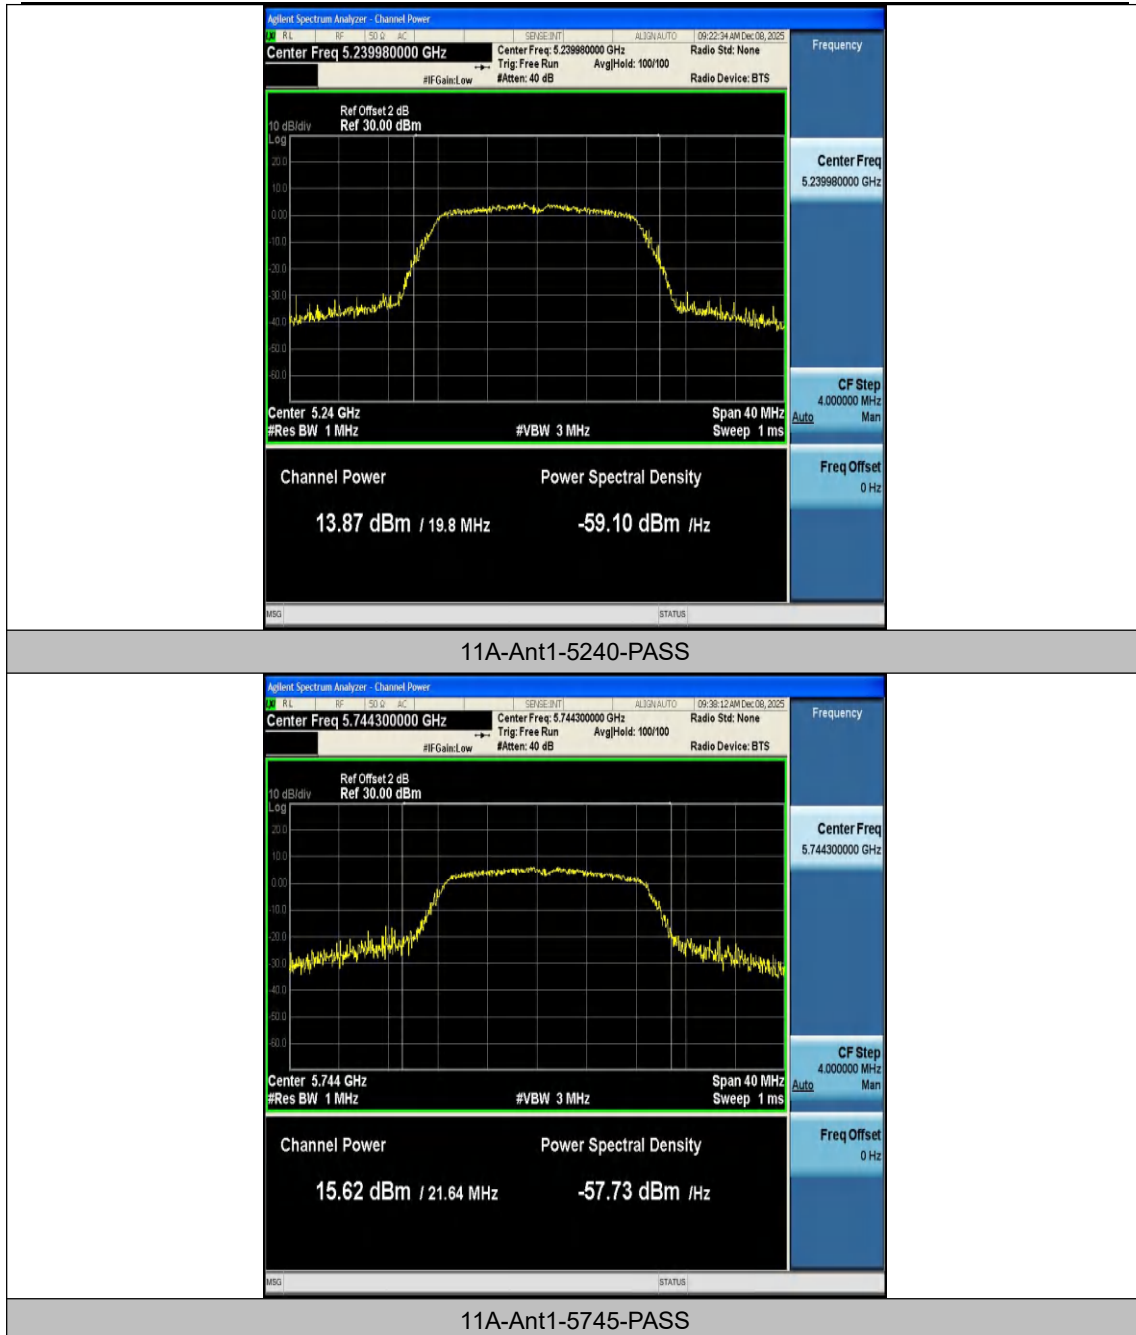


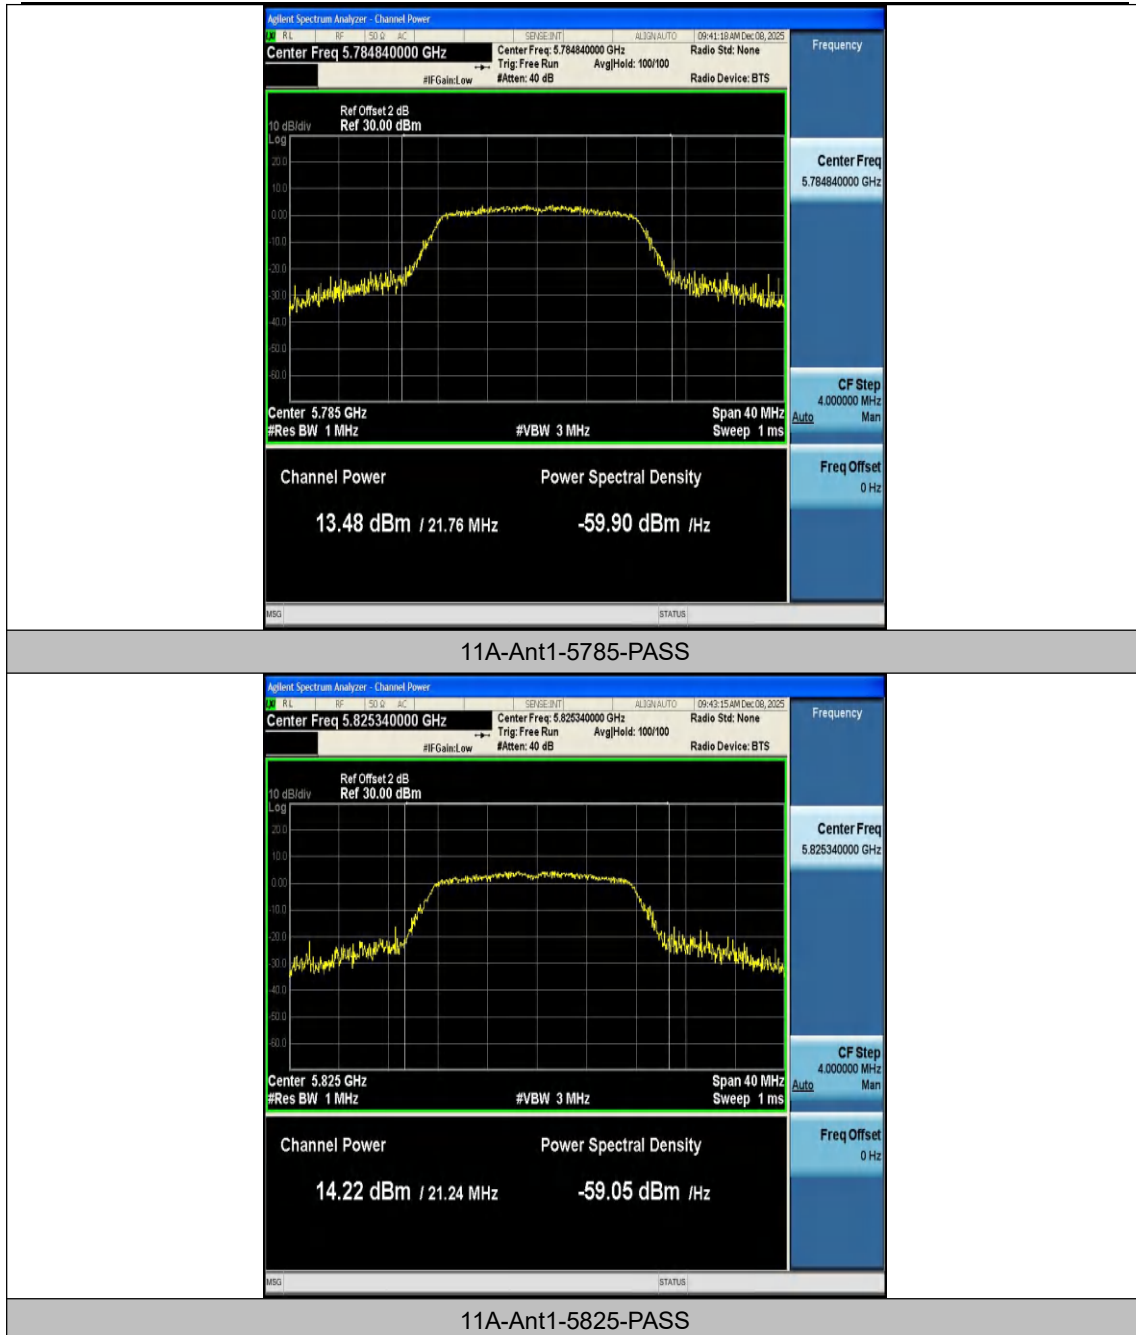

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

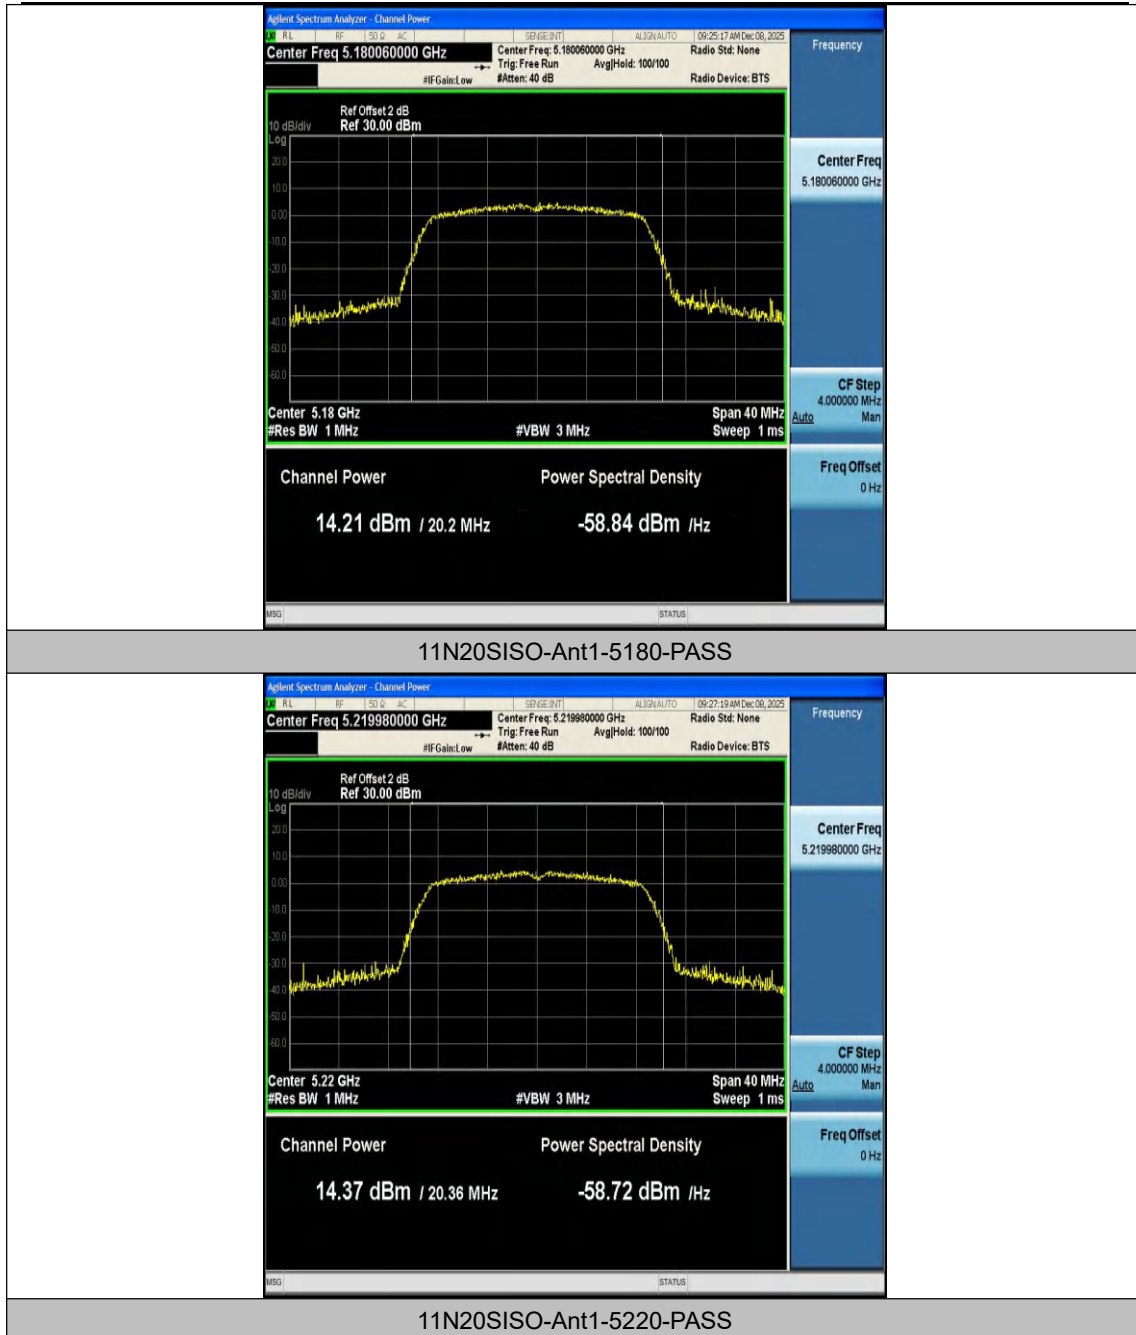

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

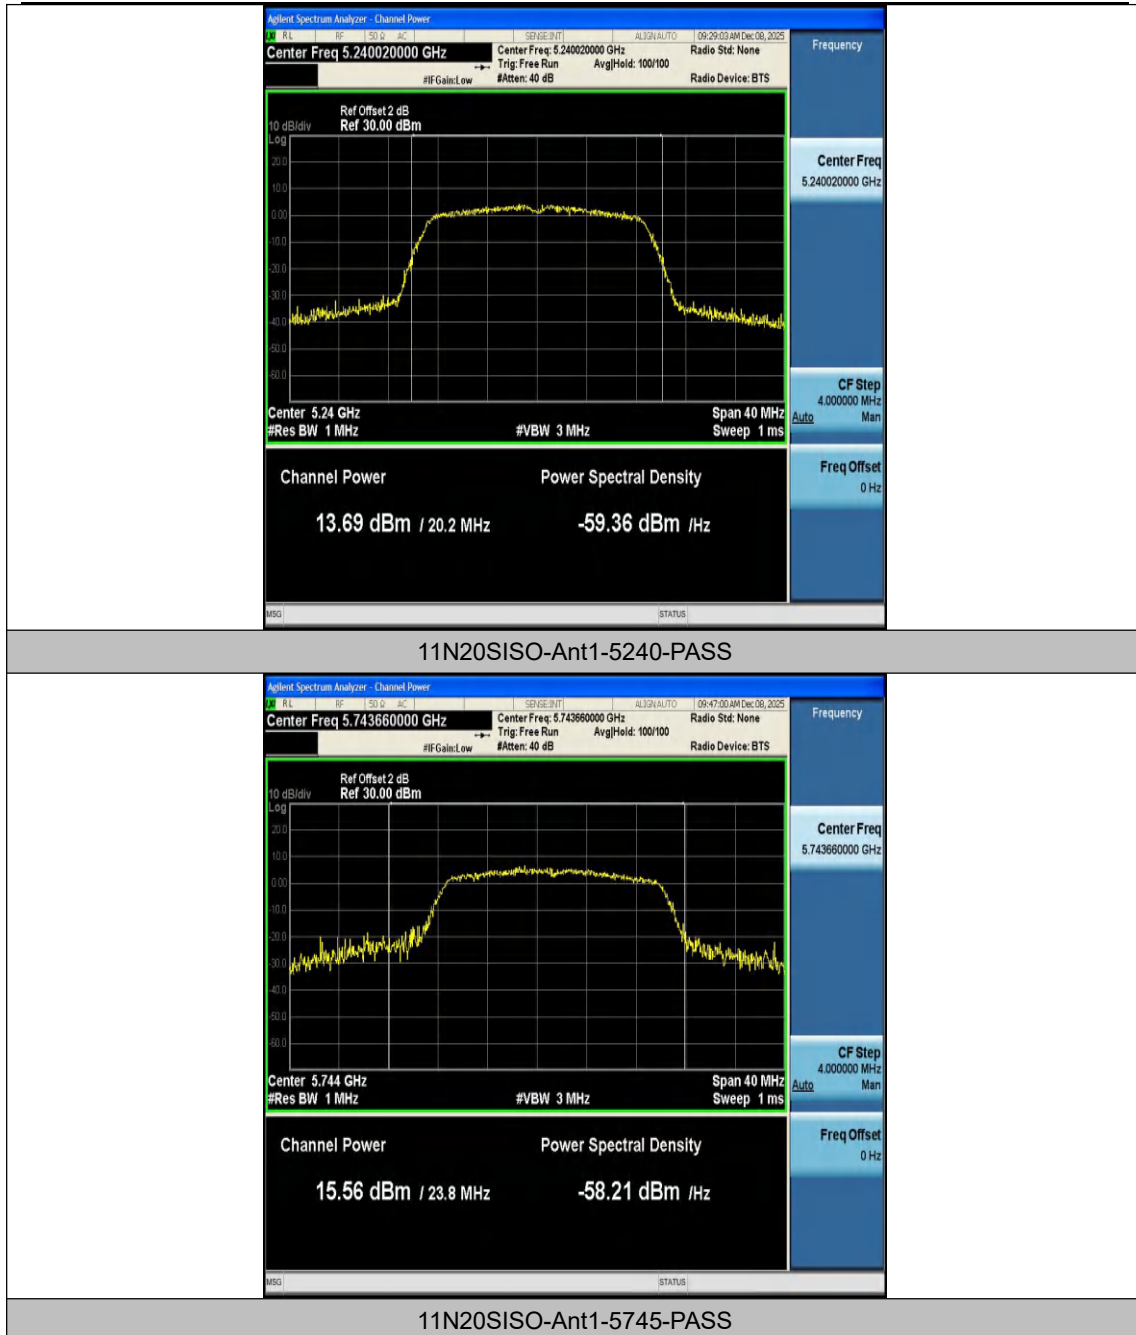

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

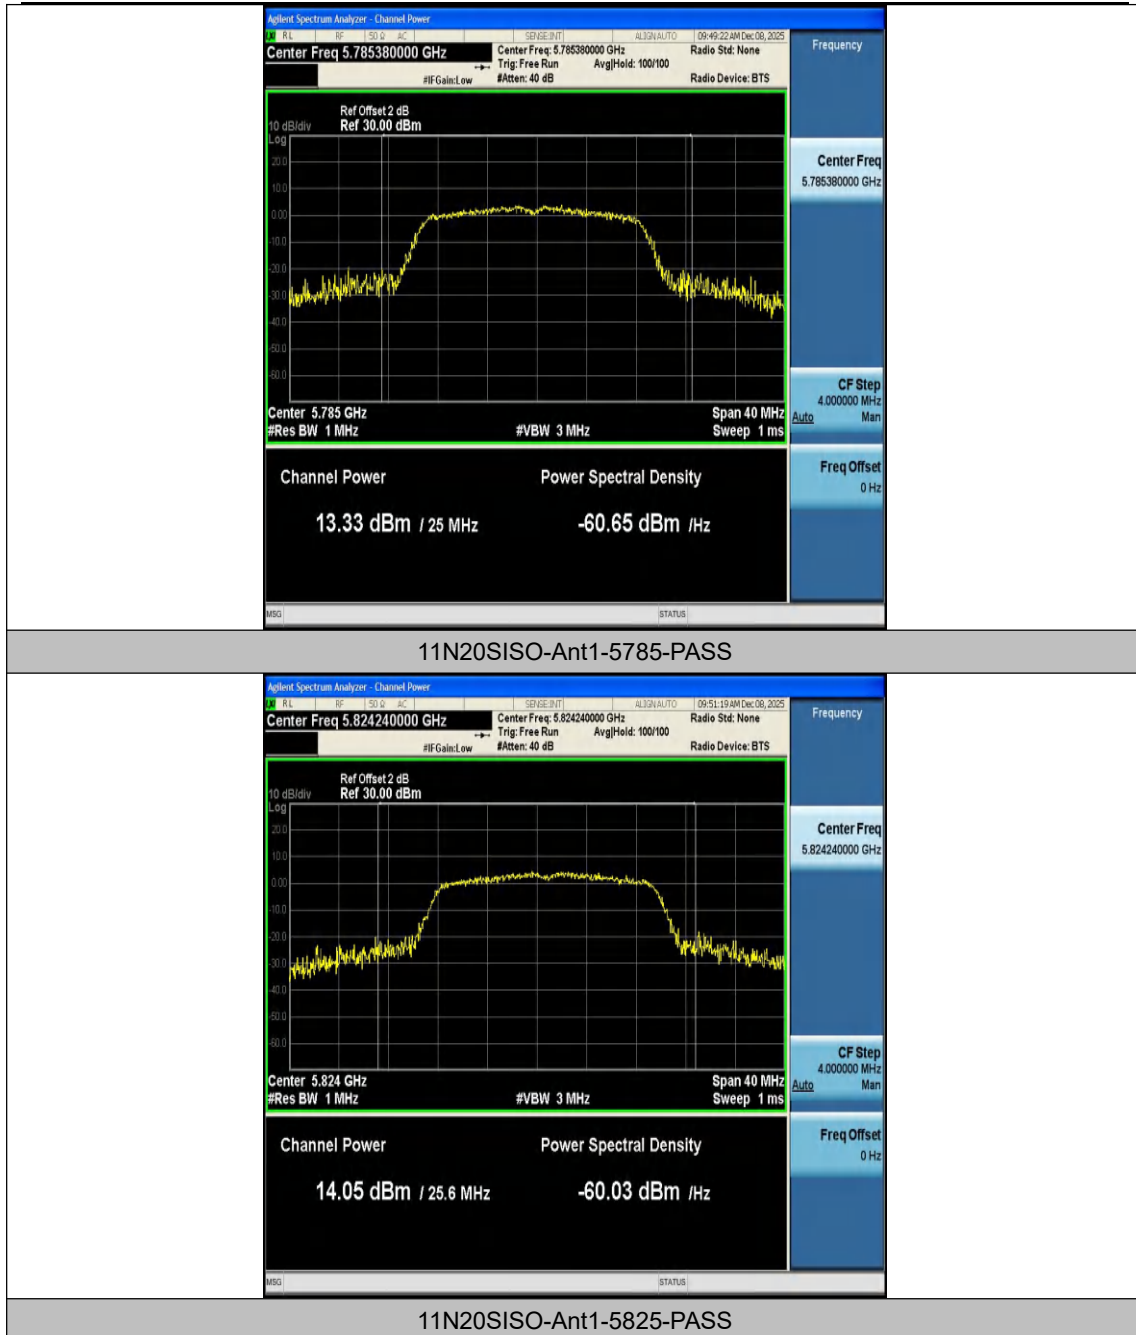

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

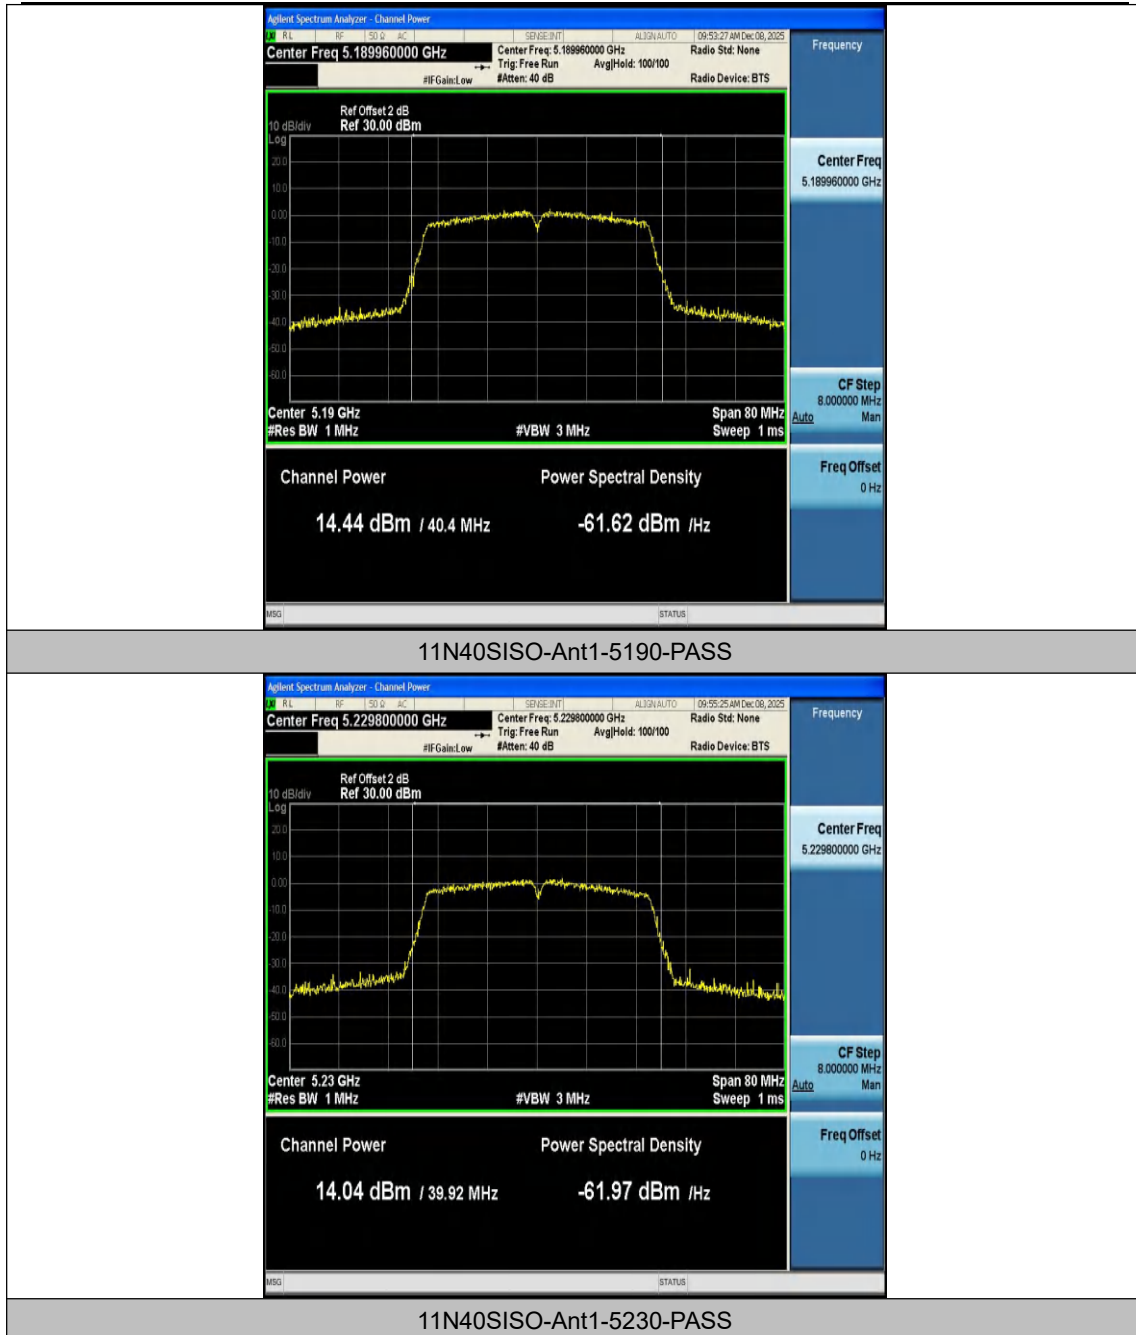

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

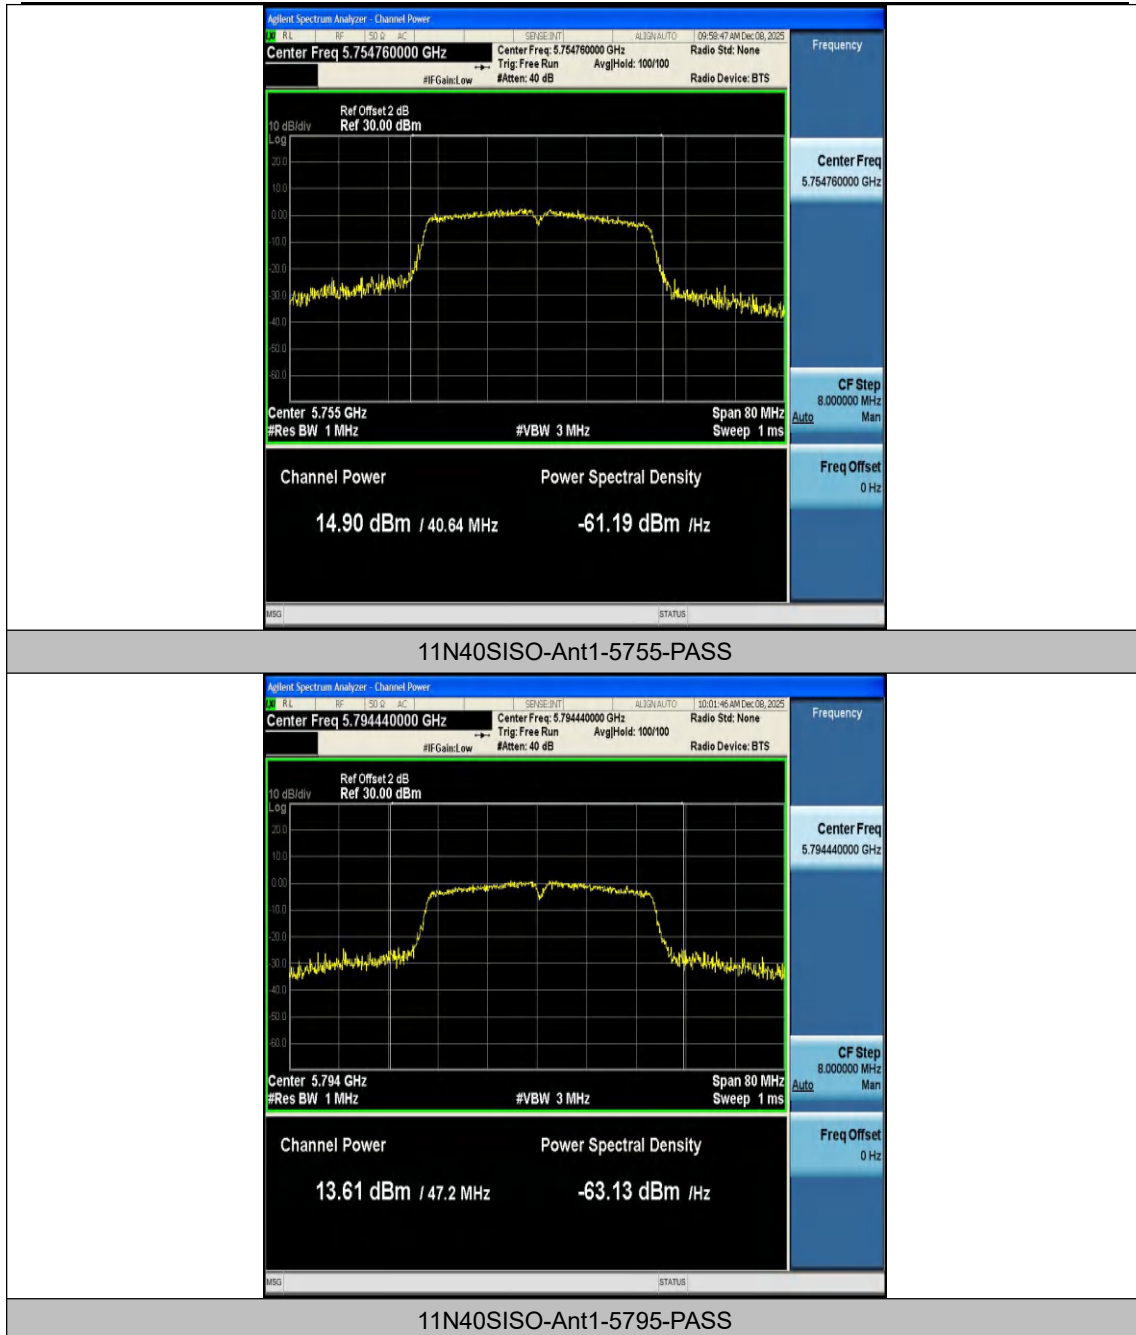

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

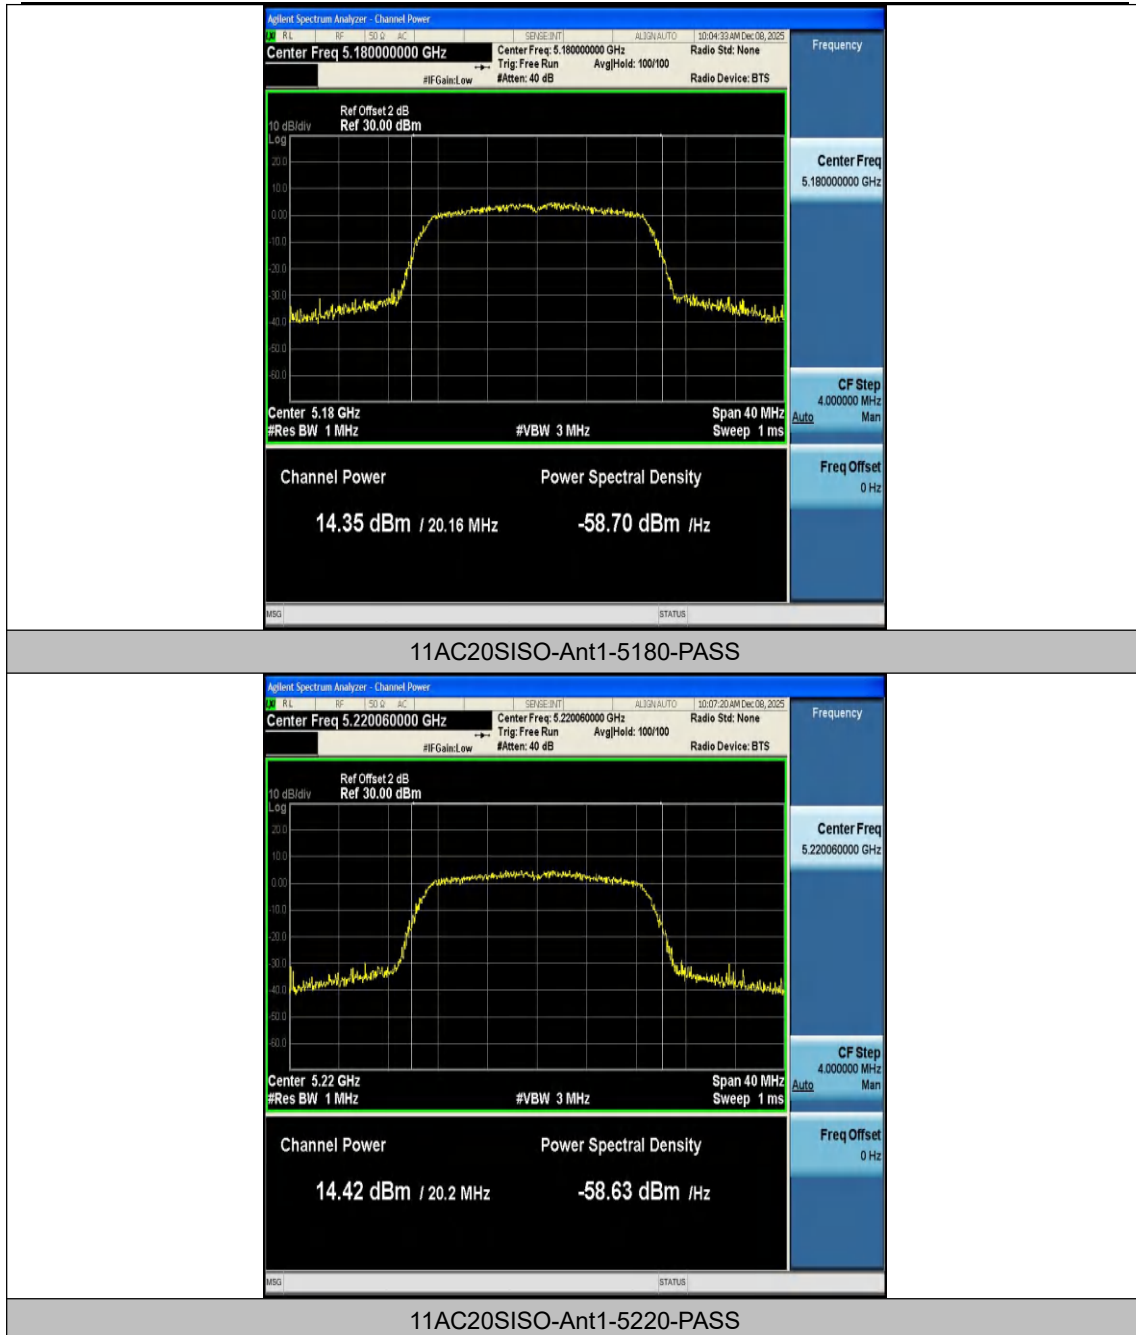


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

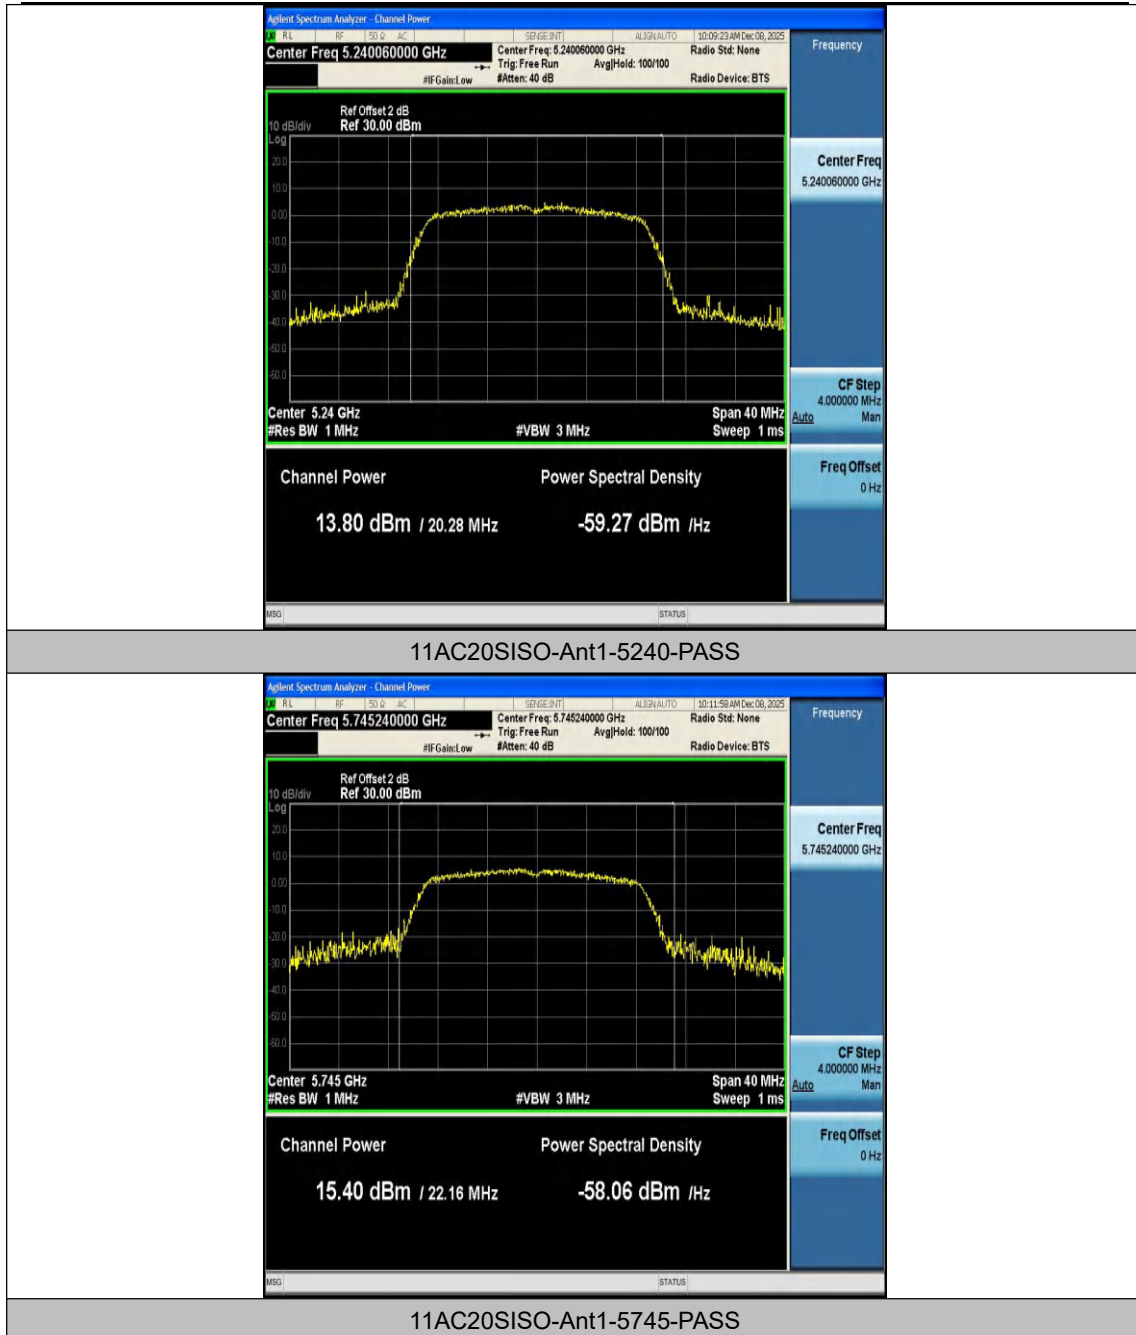


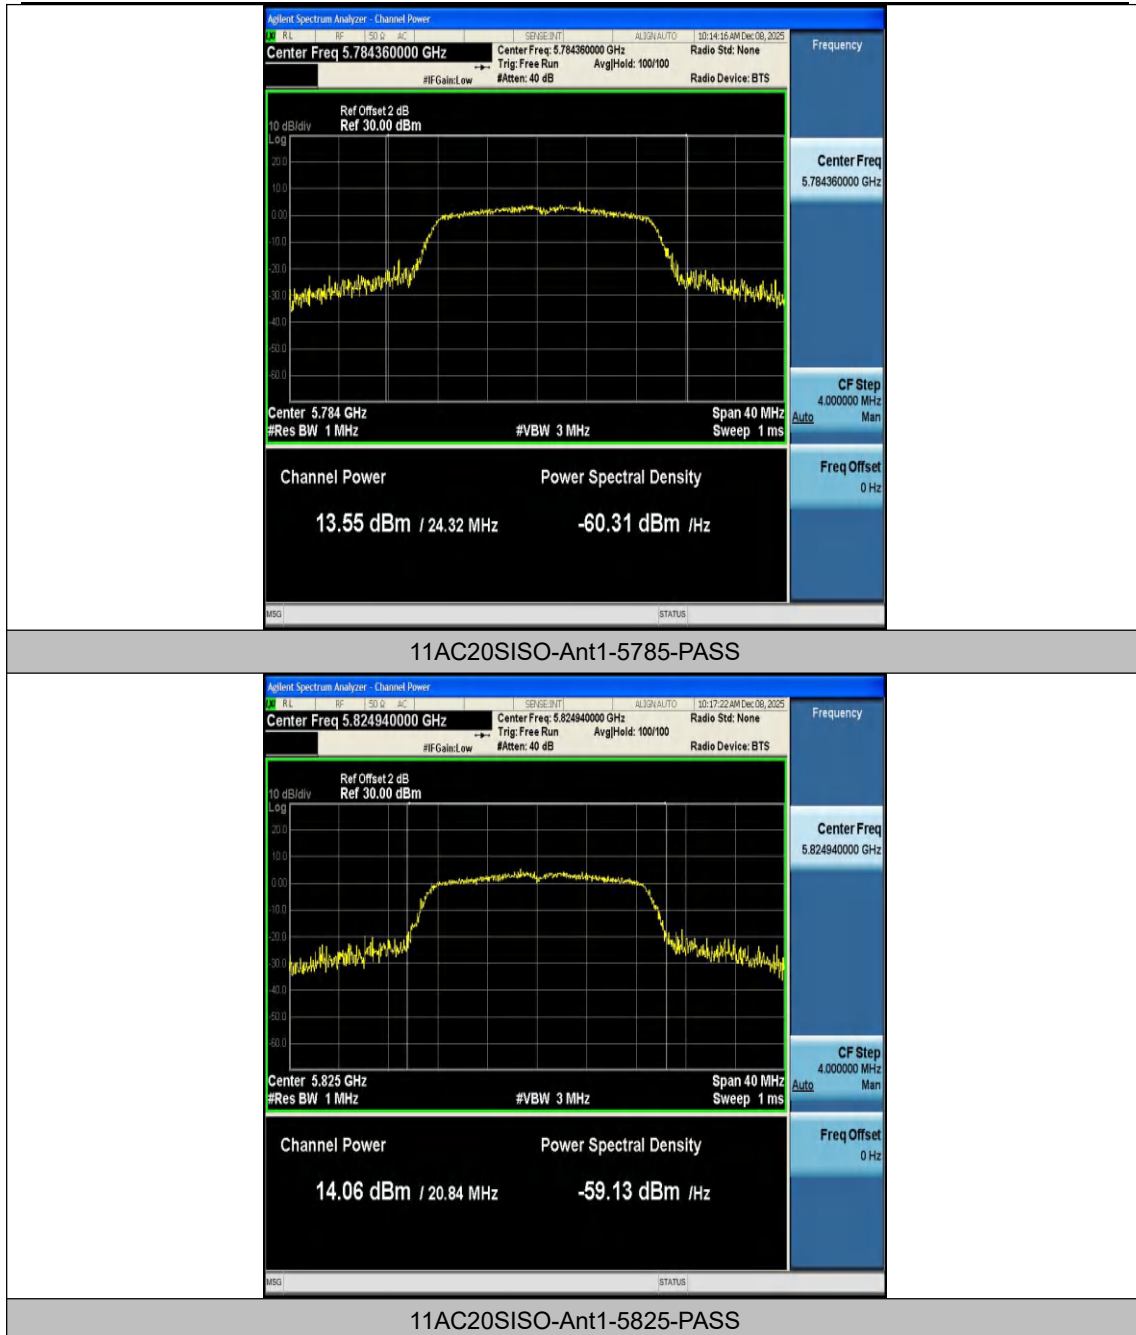

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

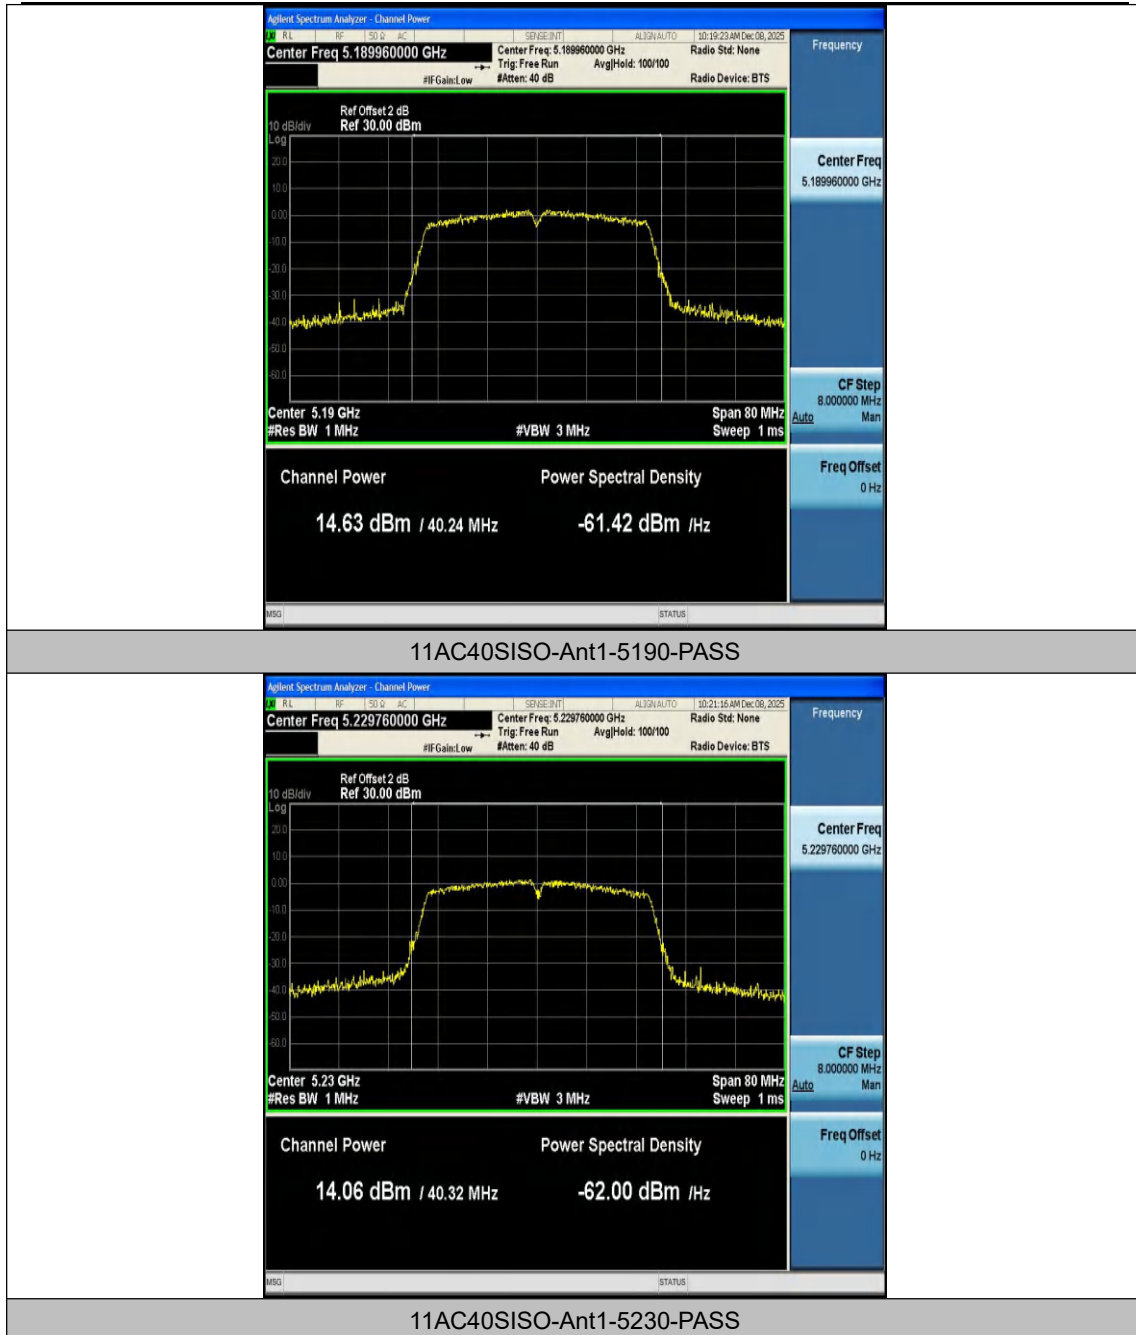

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

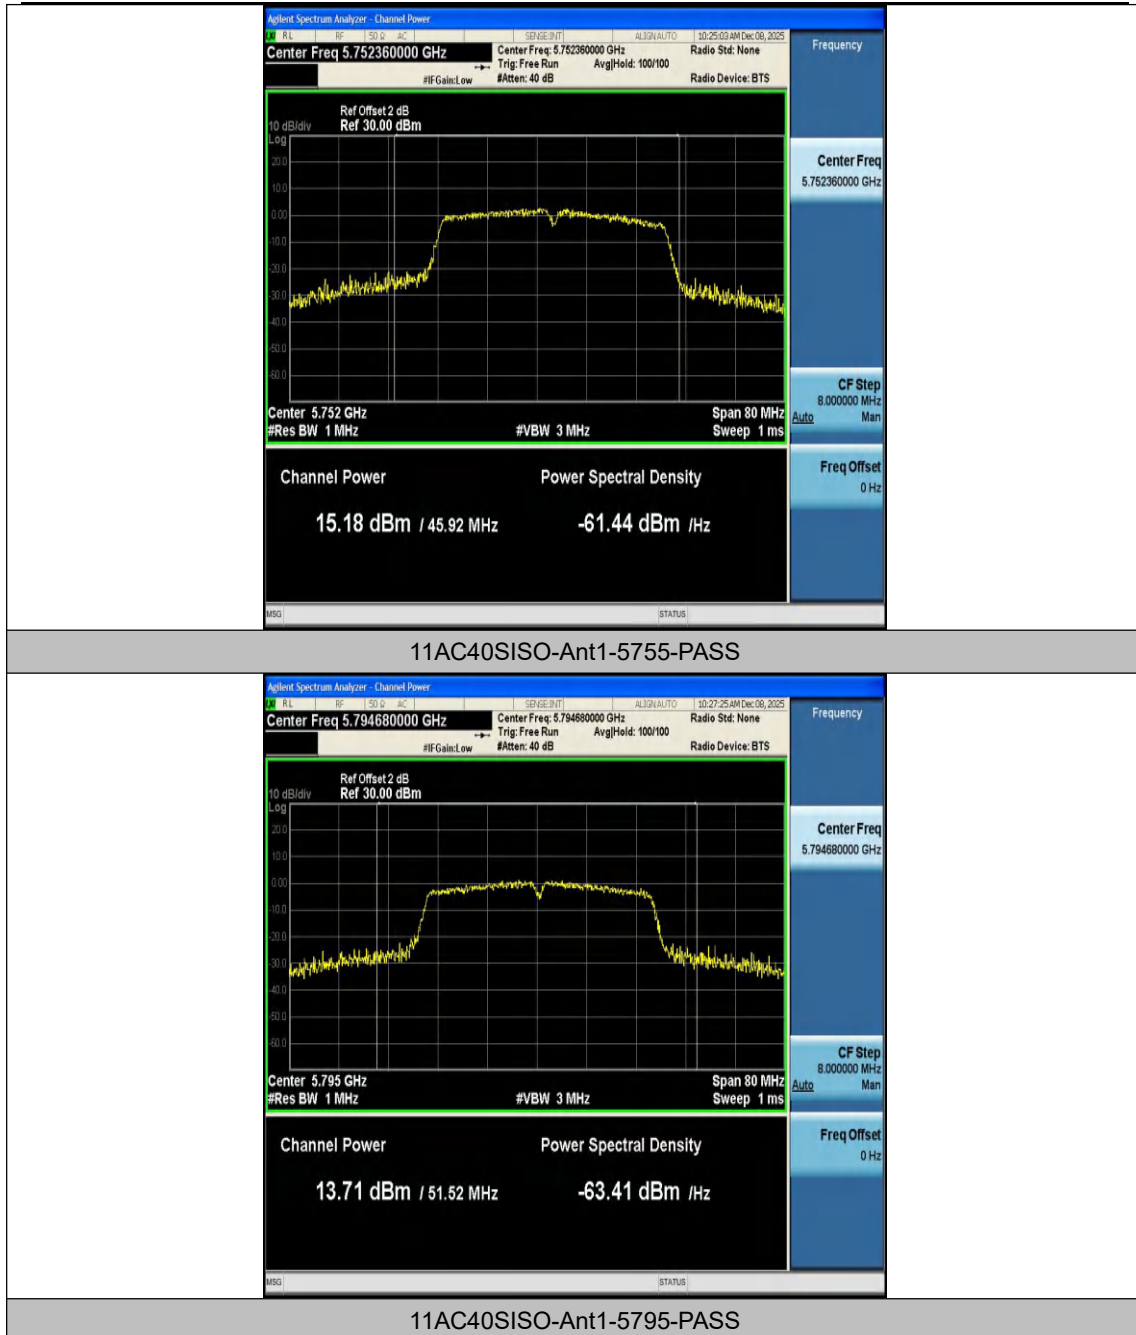

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

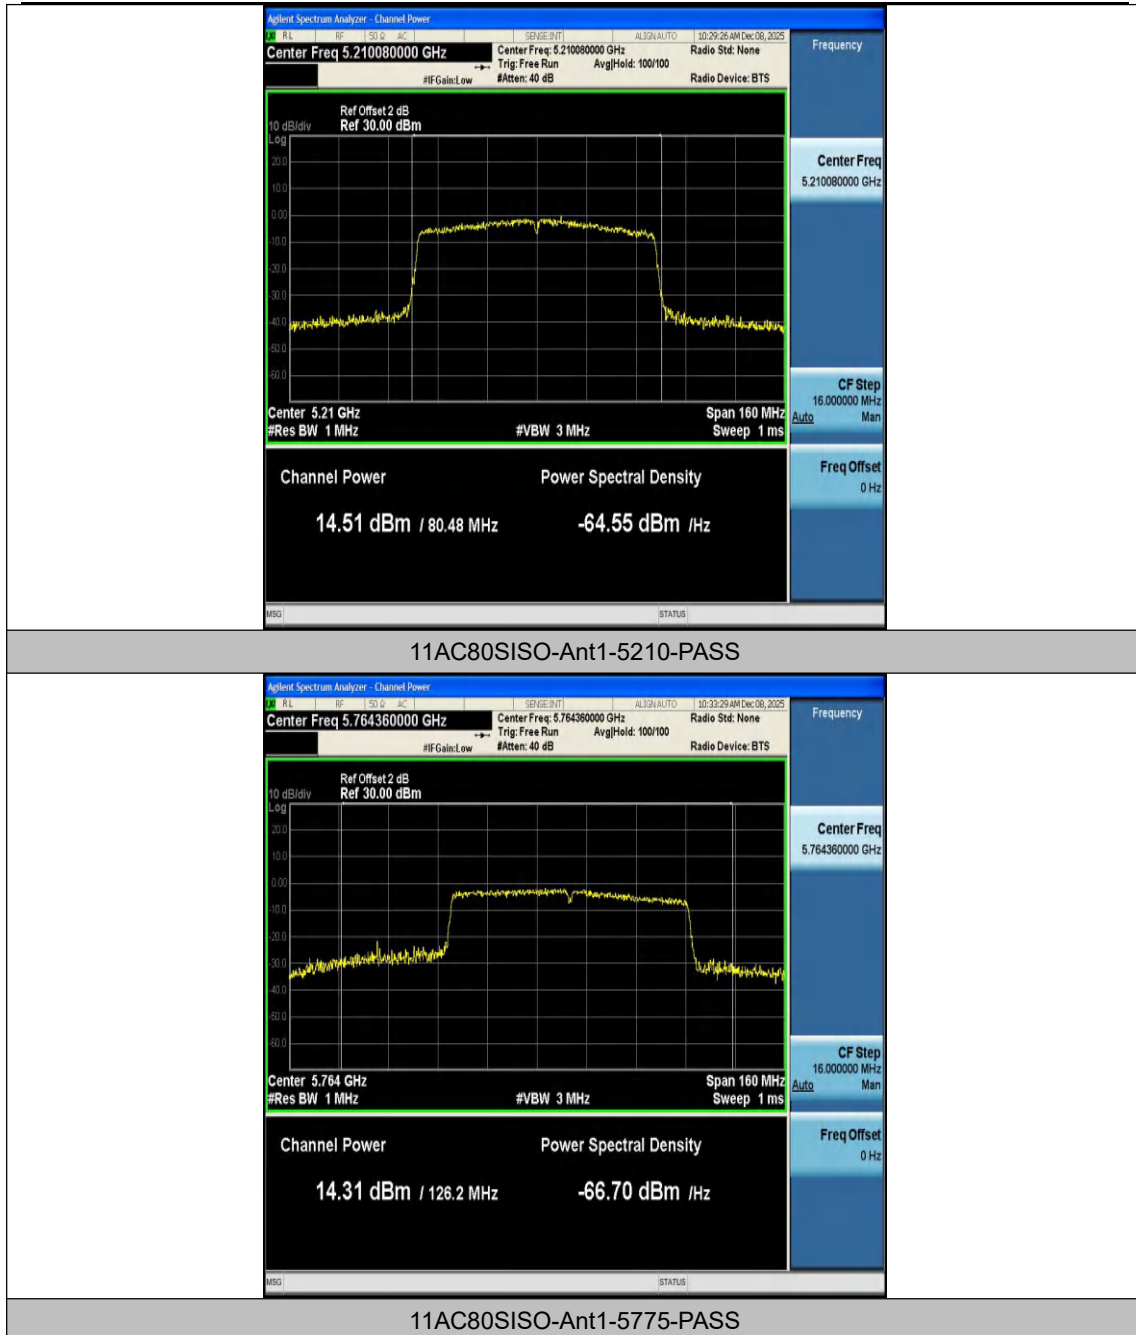

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-0.25	≤11.00	PASS
11A	Ant1	5220	0.12	≤11.00	PASS
11A	Ant1	5240	-0.65	≤11.00	PASS
11N20SISO	Ant1	5180	-0.54	≤11.00	PASS
11N20SISO	Ant1	5220	-0.06	≤11.00	PASS
11N20SISO	Ant1	5240	-1.24	≤11.00	PASS
11N40SISO	Ant1	5190	-3.18	≤11.00	PASS
11N40SISO	Ant1	5230	-3.49	≤11.00	PASS
11AC20SISO	Ant1	5180	-0.49	≤11.00	PASS
11AC20SISO	Ant1	5220	-0.16	≤11.00	PASS
11AC20SISO	Ant1	5240	-0.60	≤11.00	PASS
11AC40SISO	Ant1	5190	-2.99	≤11.00	PASS
11AC40SISO	Ant1	5230	-3.59	≤11.00	PASS
11AC80SISO	Ant1	5210	-6.25	≤11.00	PASS

Note: 1.The cable loss are compensated in the graph.


Test Result B4

Test Mode	Antenna	Frequency[MHz]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-1.63	≤30.00	PASS
11A	Ant1	5785	-3.81	≤30.00	PASS
11A	Ant1	5825	-2.59	≤30.00	PASS
11N20SISO	Ant1	5745	-1.77	≤30.00	PASS
11N20SISO	Ant1	5785	-4.24	≤30.00	PASS
11N20SISO	Ant1	5825	-3.26	≤30.00	PASS
11N40SISO	Ant1	5755	-5.60	≤30.00	PASS
11N40SISO	Ant1	5795	-7.11	≤30.00	PASS
11AC20SISO	Ant1	5745	-2.13	≤30.00	PASS
11AC20SISO	Ant1	5785	-4.05	≤30.00	PASS
11AC20SISO	Ant1	5825	-3.23	≤30.00	PASS
11AC40SISO	Ant1	5755	-5.39	≤30.00	PASS
11AC40SISO	Ant1	5795	-6.90	≤30.00	PASS
11AC80SISO	Ant1	5775	-9.99	≤30.00	PASS

Note: 1.The cable loss and RBW Factor are compensated in the graph.

2.Offset=cable loss(2dB) + RBW Factor (2.22dB)


Test Graphs B1

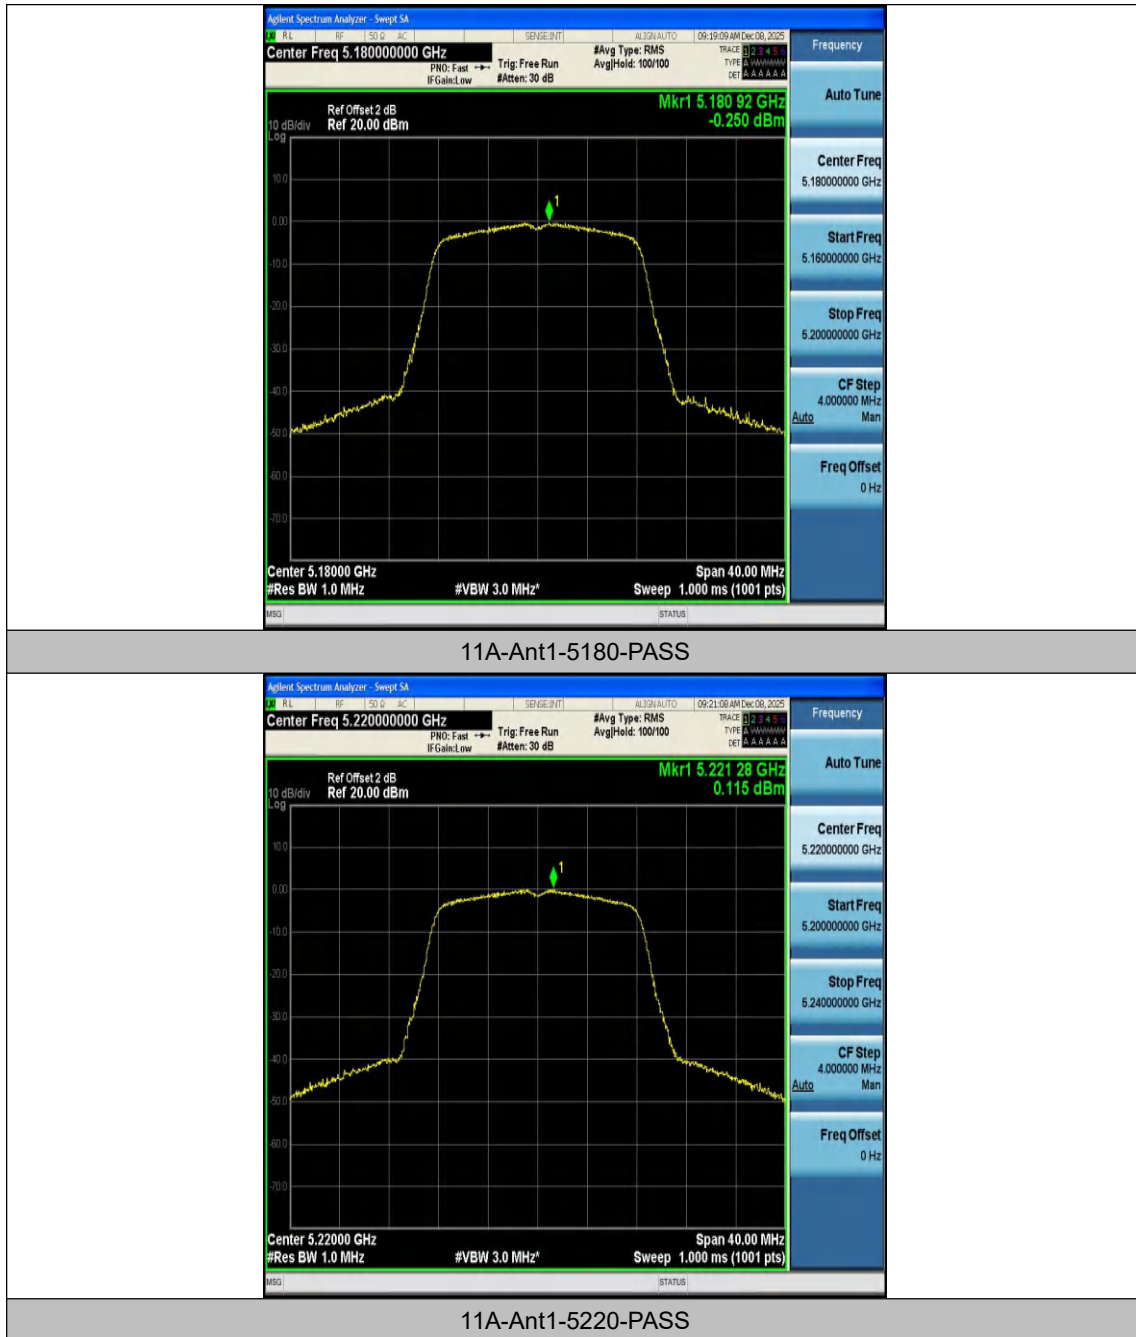

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

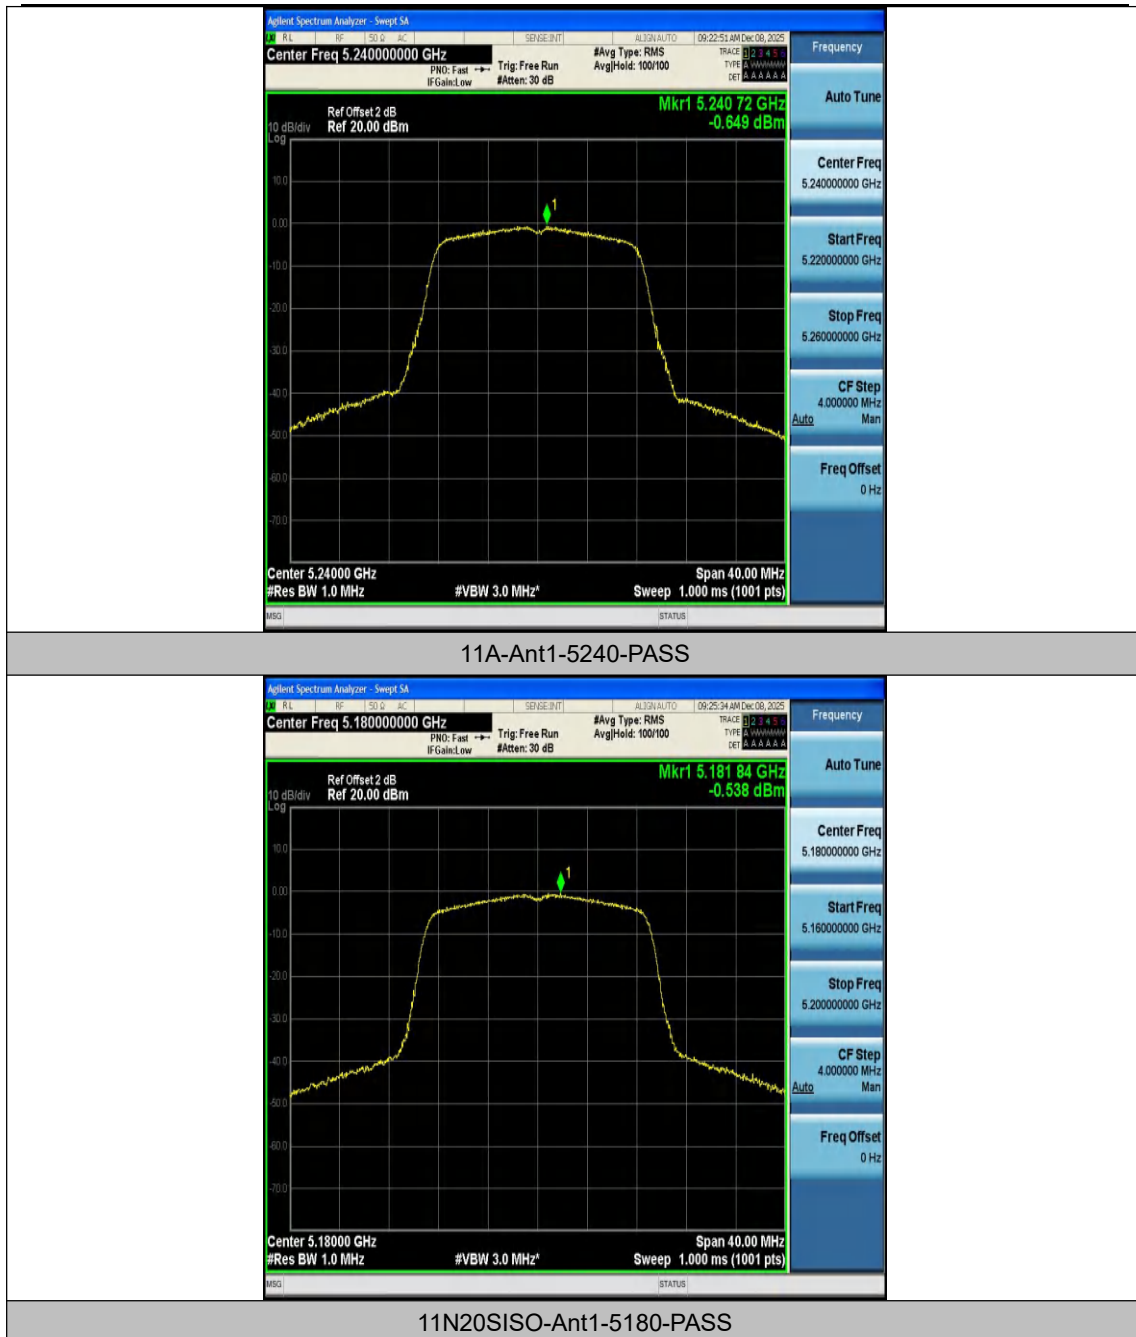

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

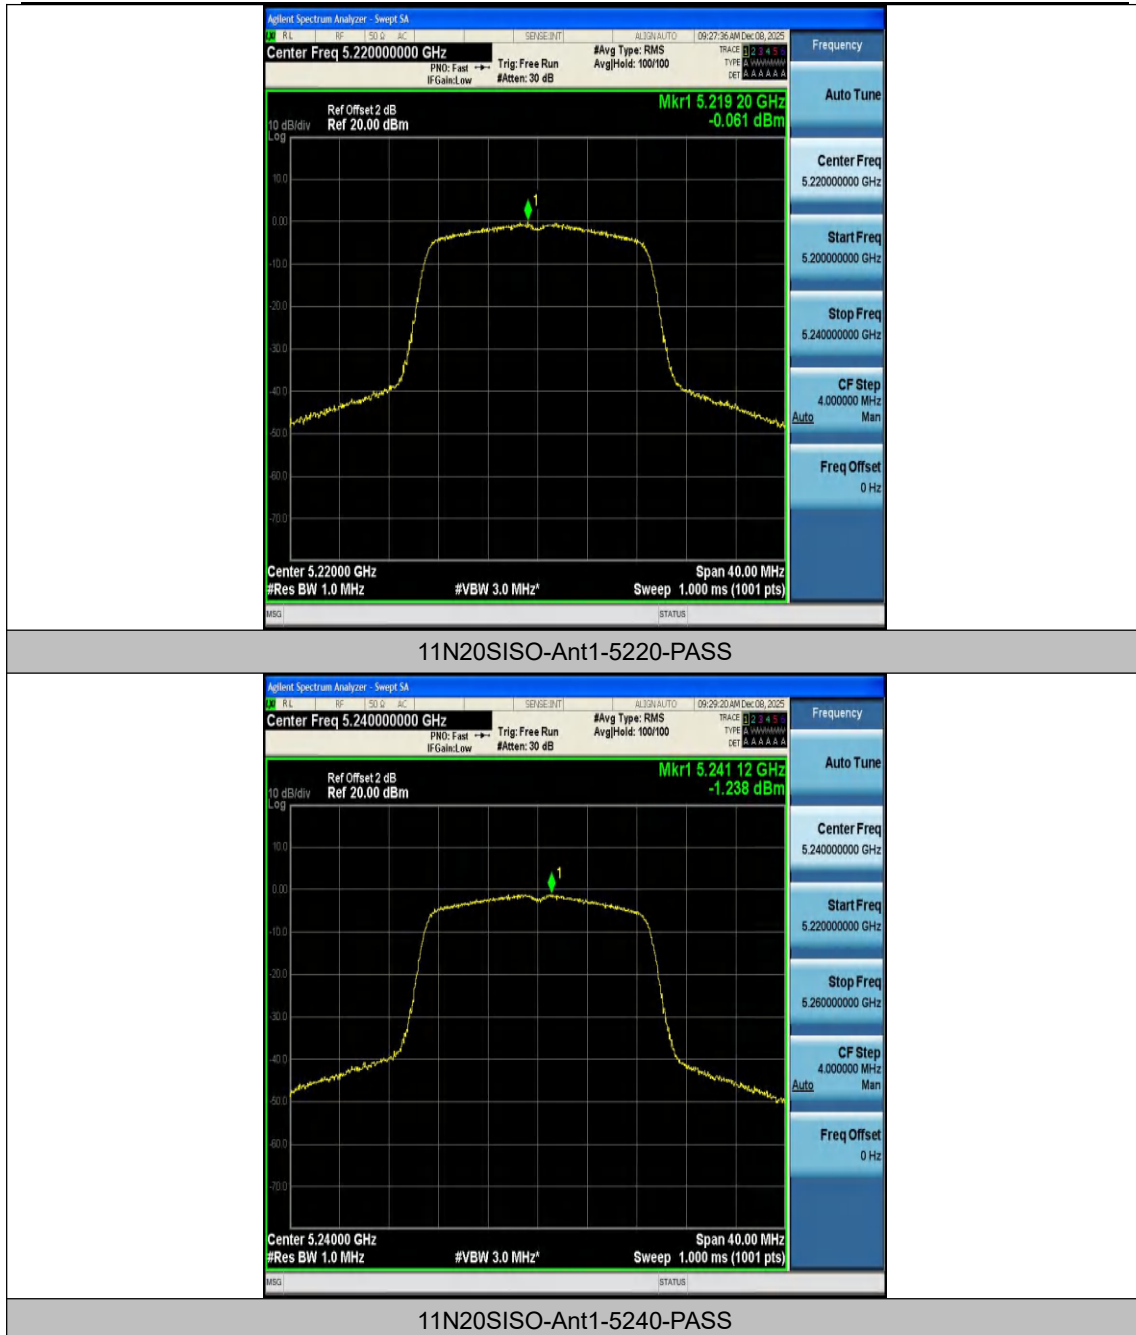

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

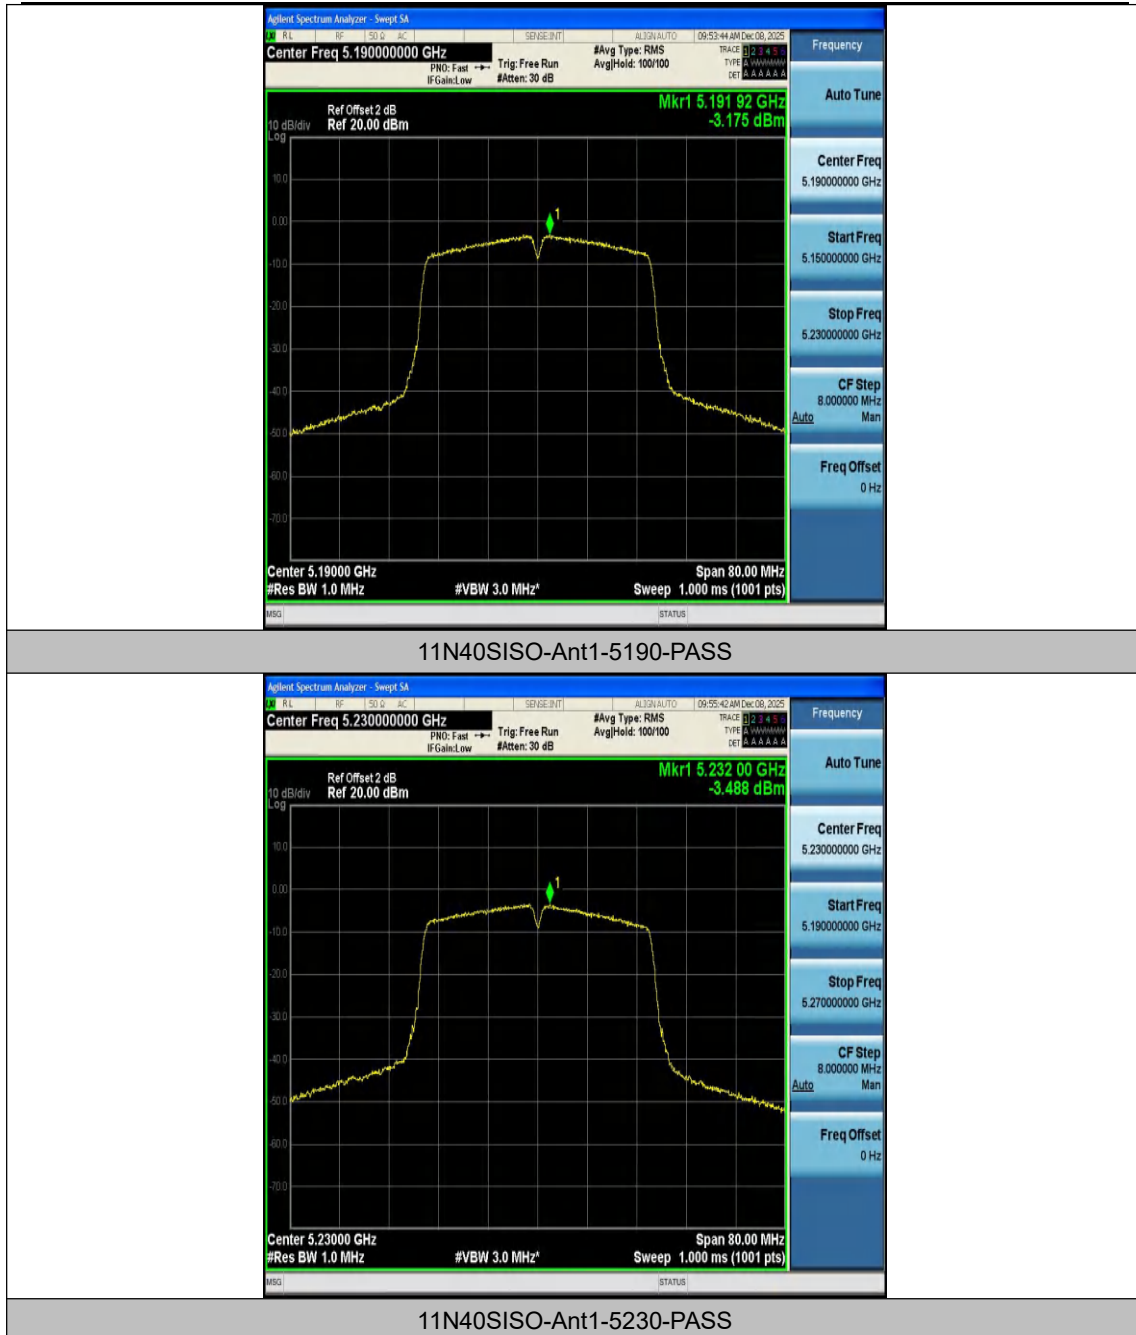

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

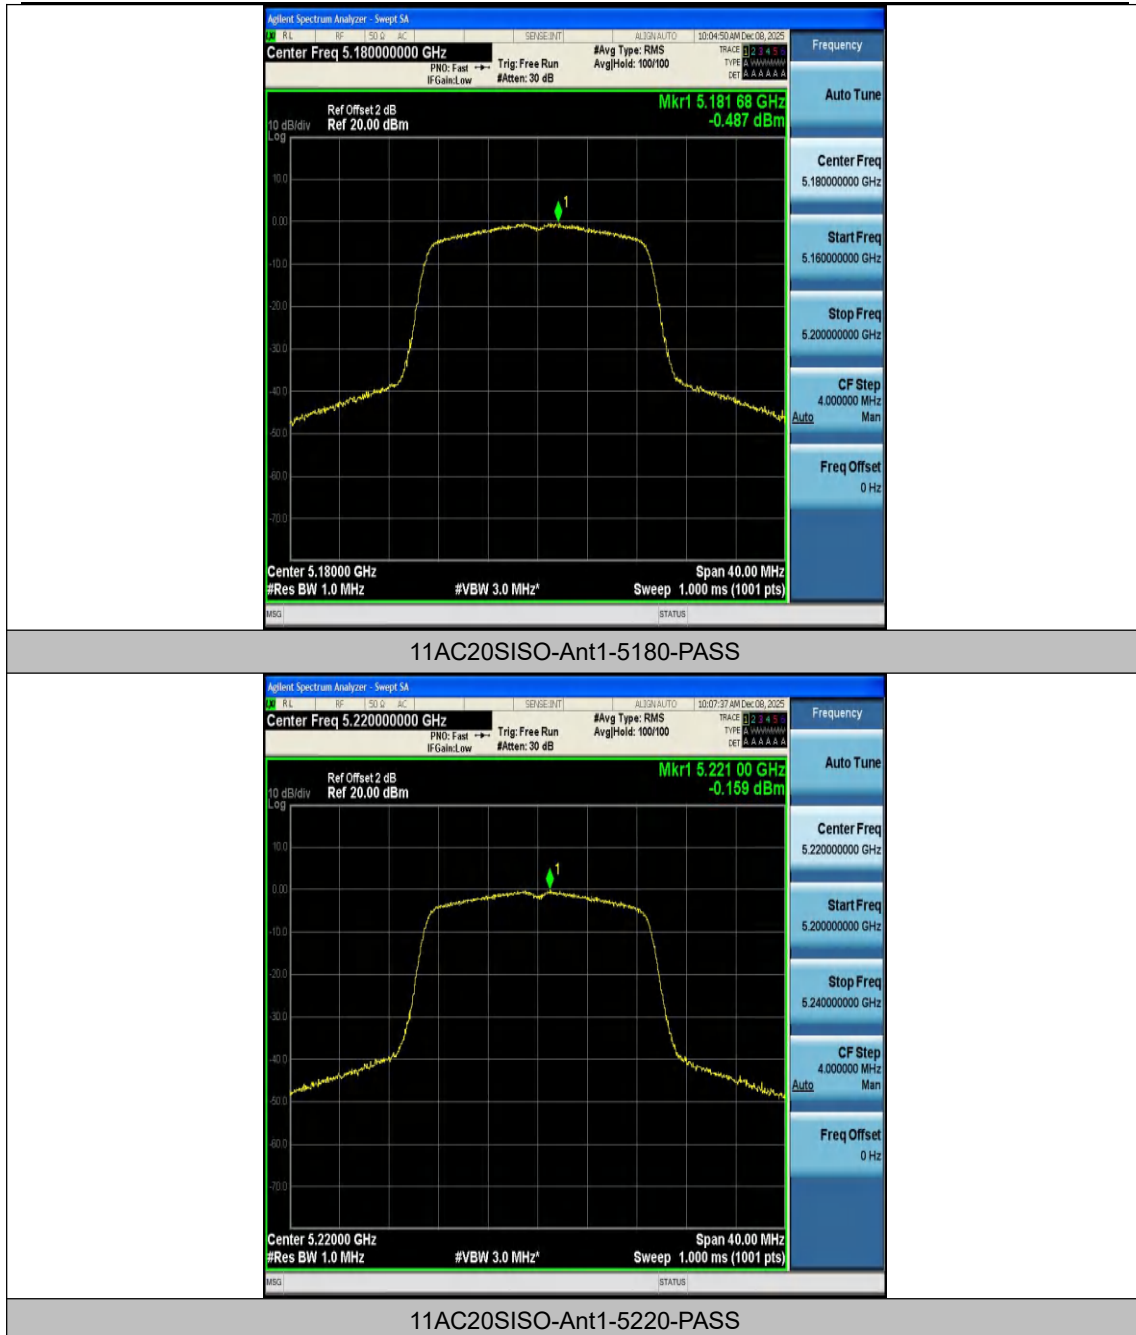

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

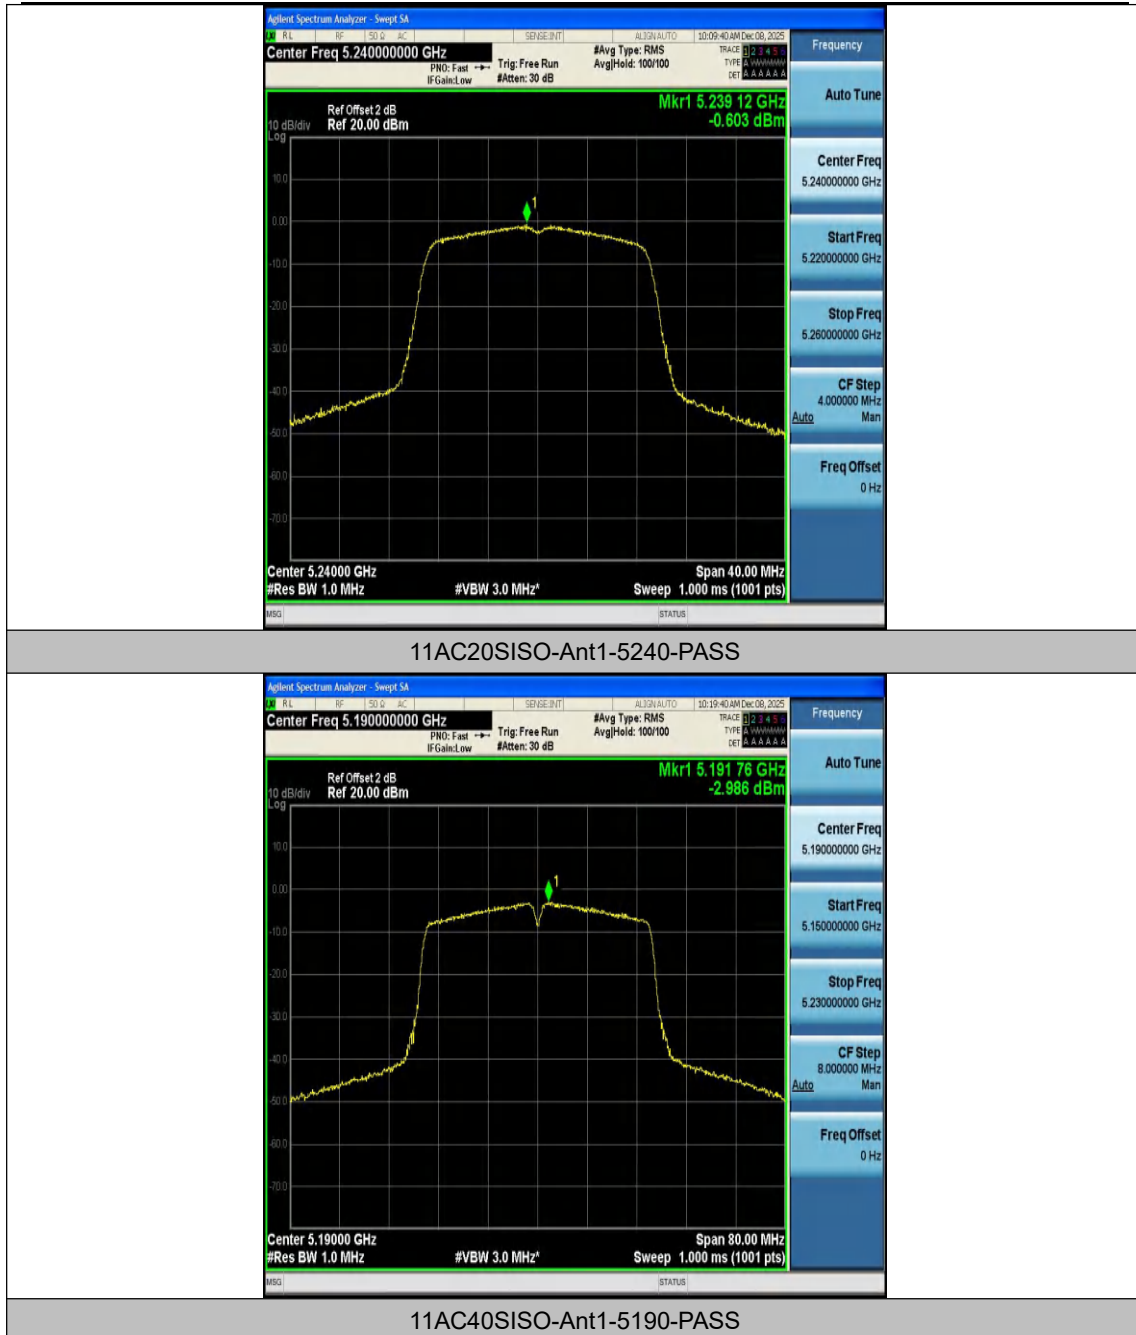

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

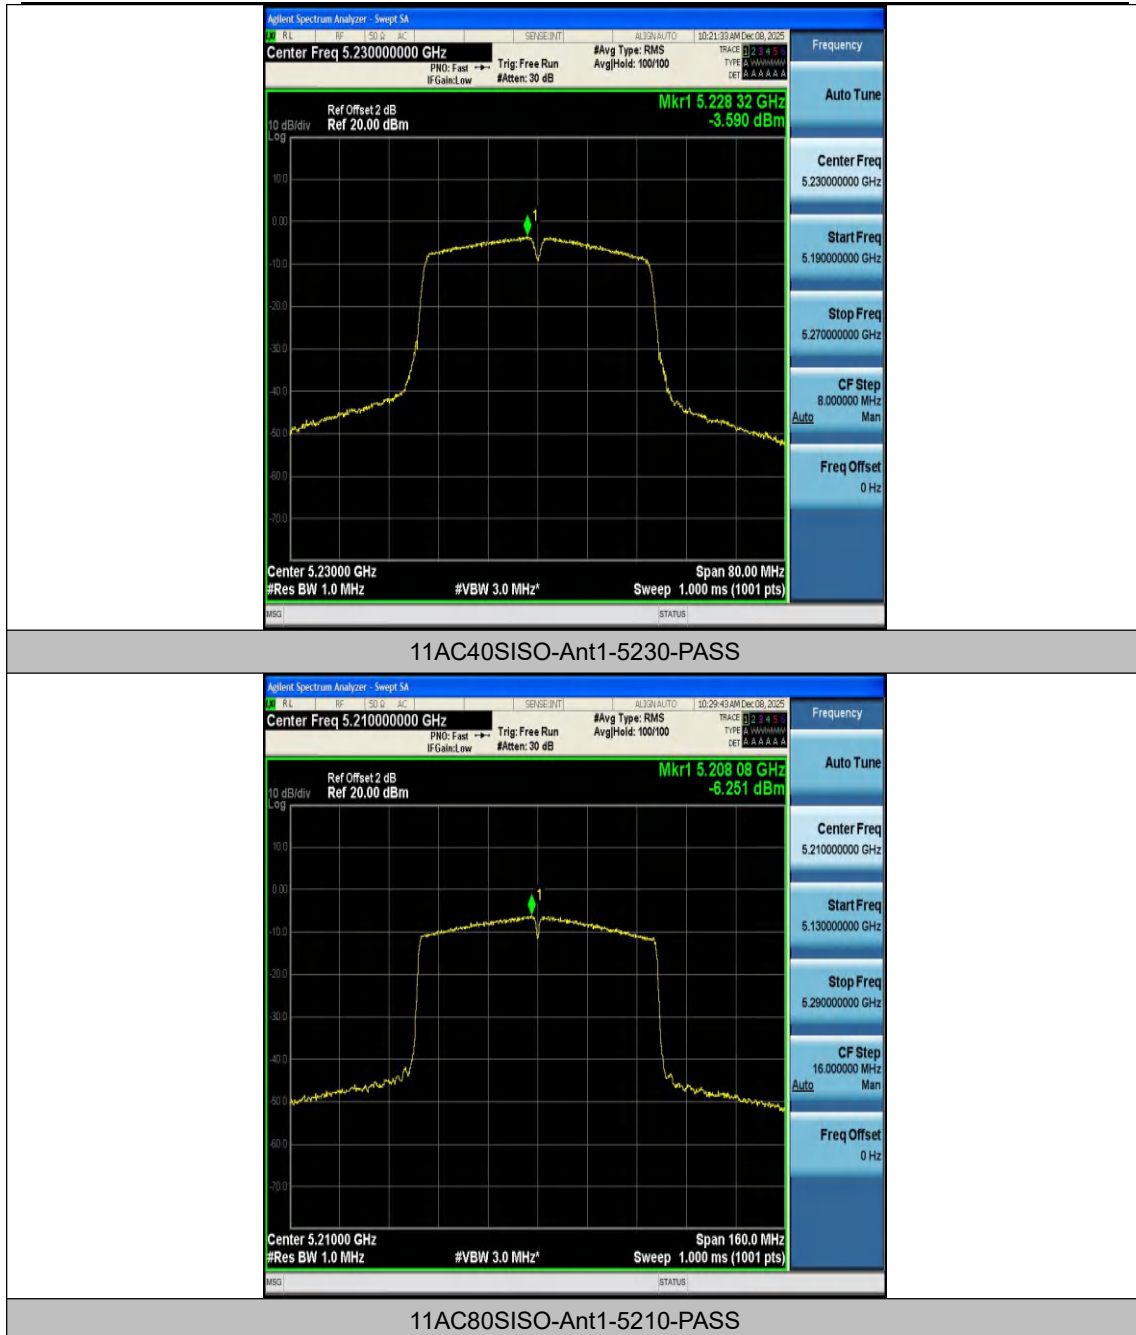


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test GraphsB4

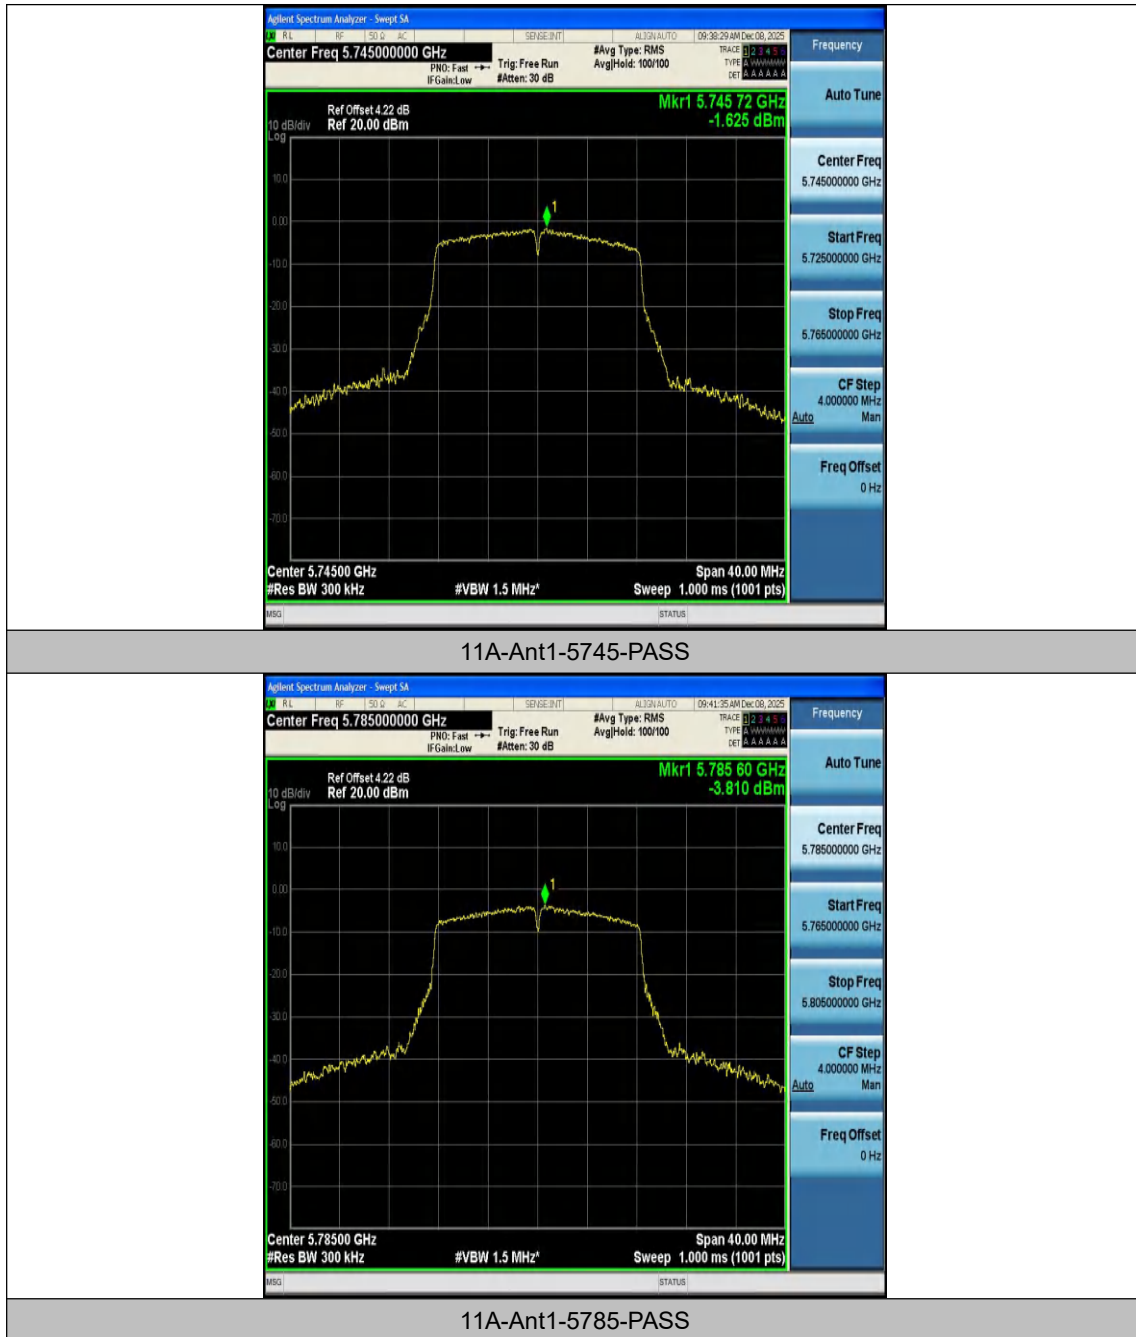

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

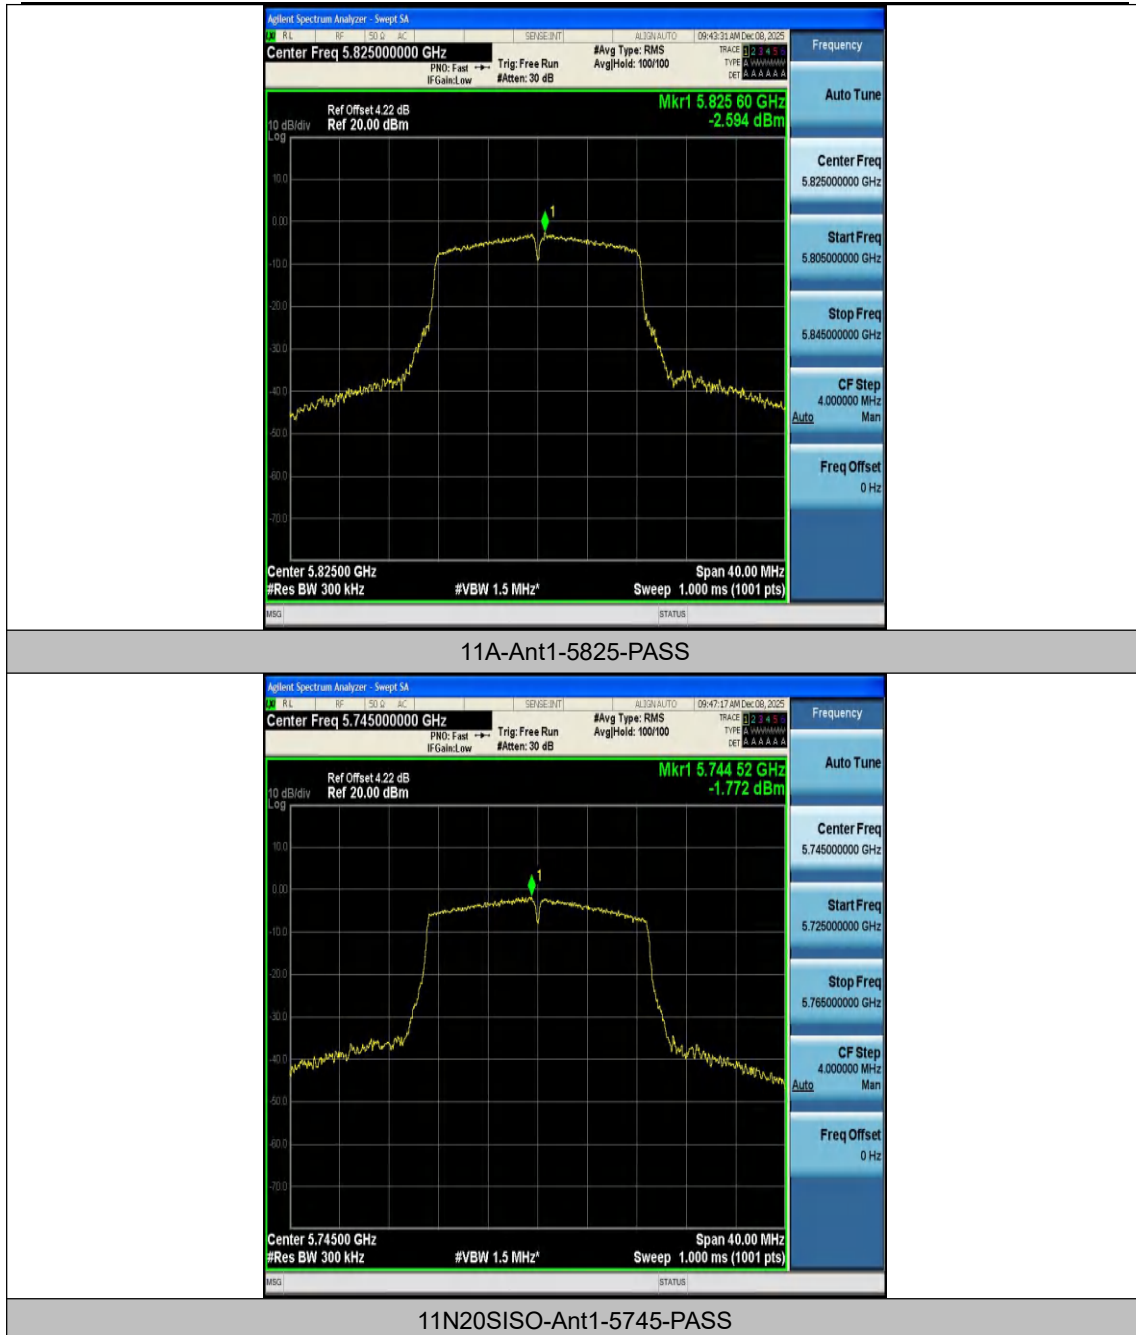

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

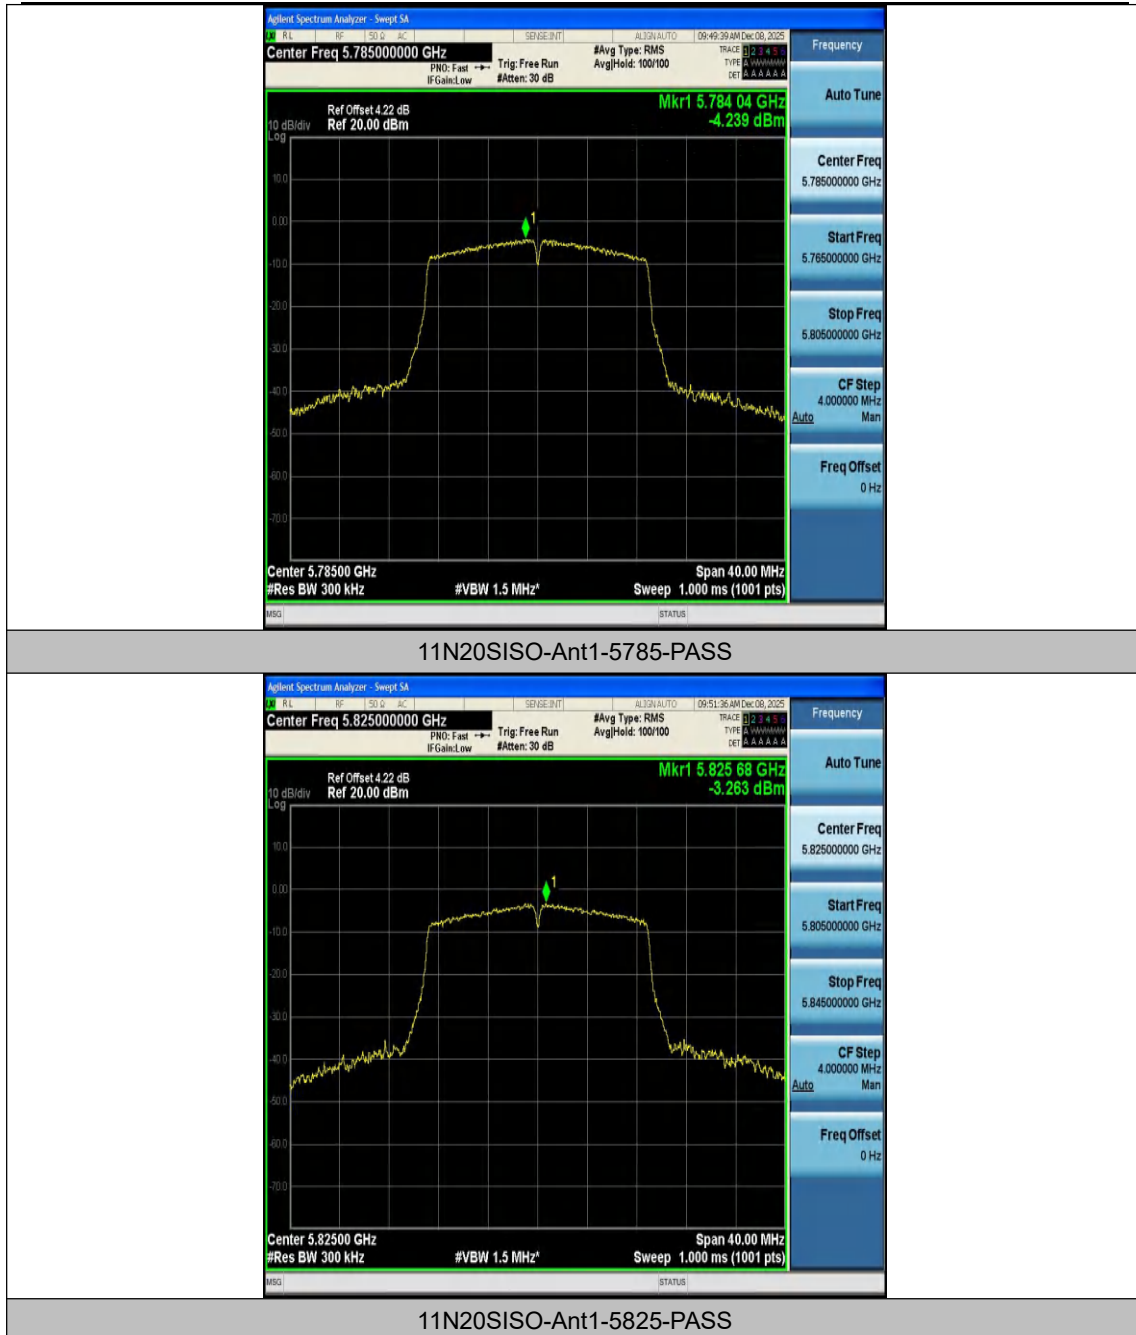

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

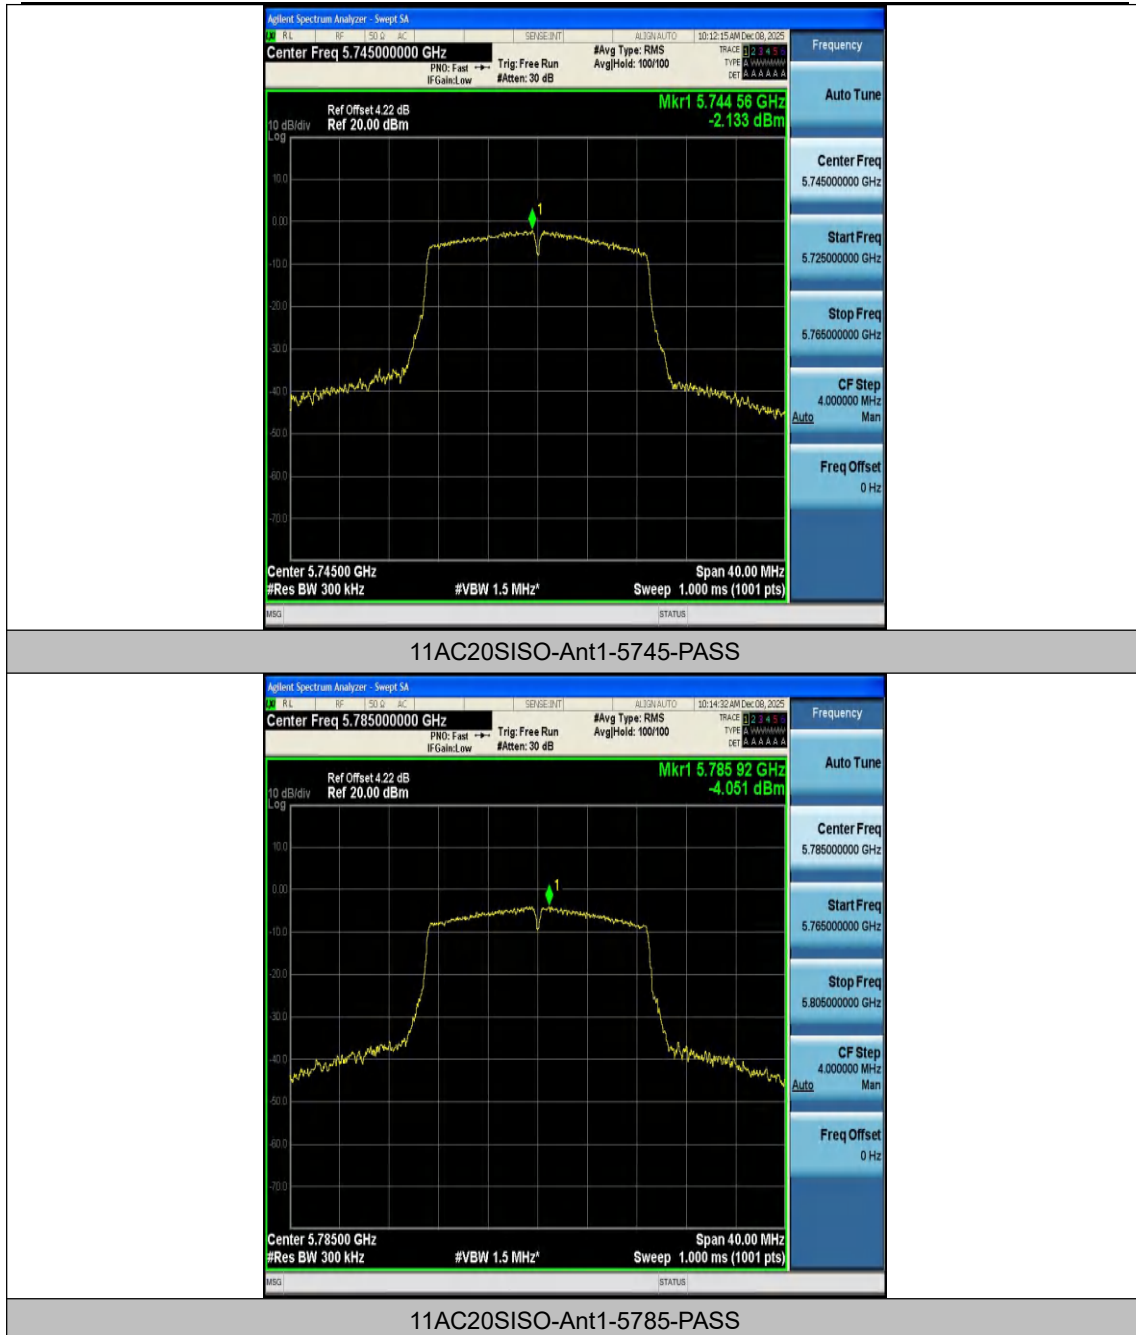

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

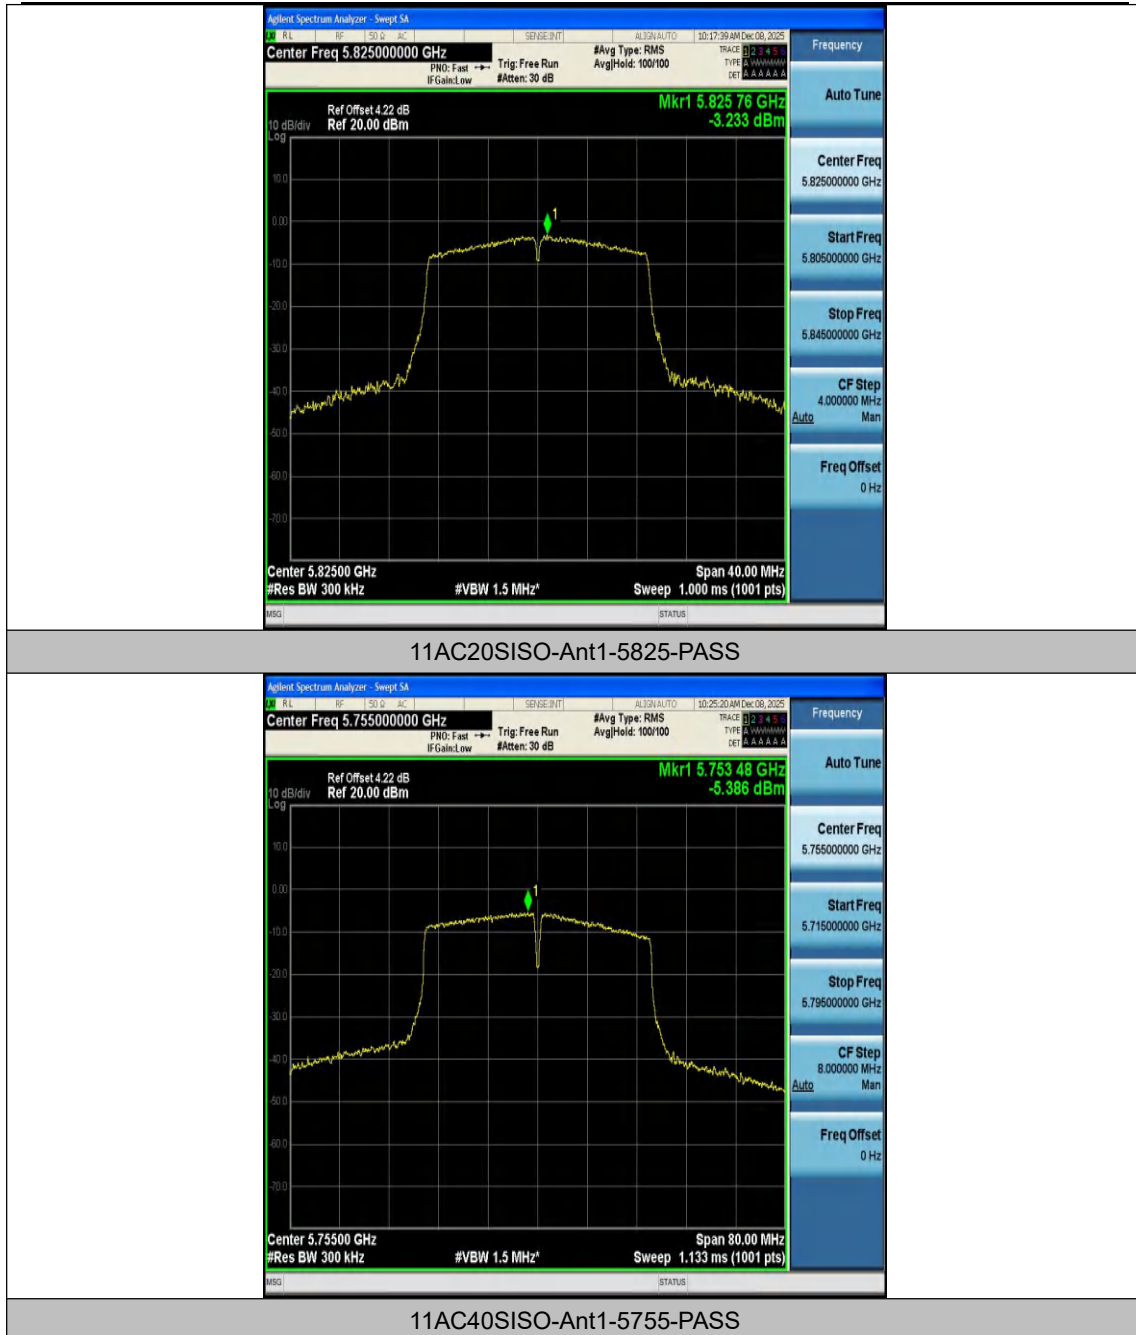

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

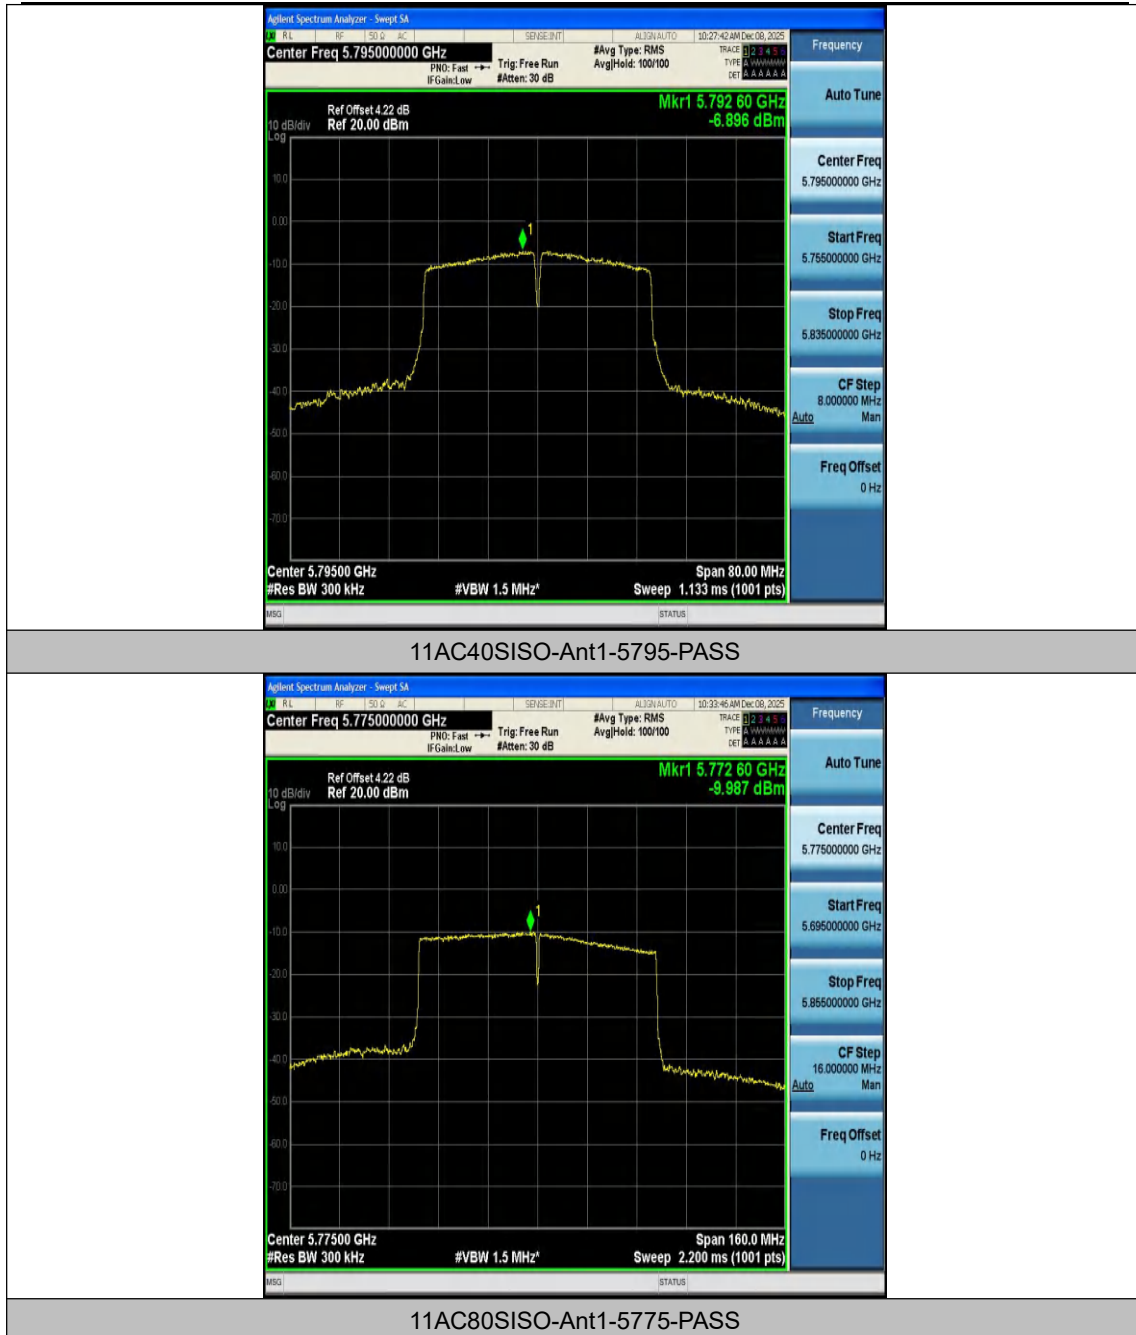

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-40.56	≤-27	PASS
11A	Ant1	High	5240	-46.57	≤-27	PASS
11N20SISO	Ant1	Low	5180	-43.15	≤-27	PASS
11N20SISO	Ant1	High	5240	-45.04	≤-27	PASS
11N40SISO	Ant1	Low	5190	-36.66	≤-27	PASS
11N40SISO	Ant1	High	5230	-46.21	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-41.93	≤-27	PASS
11AC20SISO	Ant1	High	5240	-46.9	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-36.89	≤-27	PASS
11AC40SISO	Ant1	High	5230	-45.77	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-33.87	≤-27	PASS
11AC80SISO	Ant1	High	5210	-45.4	≤-27	PASS

Note: Offset=cable loss+Antenna gain, Gain=1.5dBi


Test Result B4

Test Mode	Antenna	Ch. Name	Frequency [MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-19.47	≤23.94	PASS
11A	Ant1	Low	5745	5700~5720	-30.41	≤12.92	PASS
11A	Ant1	Low	5745	5650~5700	-46.34	≤-26.87	PASS
11A	Ant1	Low	5745	5645~5650	-44.2	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-30.57	≤18.19	PASS
11A	Ant1	High	5825	5855~5875	-32.51	≤15.09	PASS
11A	Ant1	High	5825	5875~5925	-46.83	≤-25.51	PASS
11A	Ant1	High	5825	5925~5935	-46.24	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-27.9	≤15.82	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-28.3	≤14.73	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-45.92	≤-26.96	PASS
11N20SISO	Ant1	Low	5745	5645~5650	-45.35	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-33.02	≤17.57	PASS
11N20SISO	Ant1	High	5825	5855~5875	-32.47	≤15.39	PASS
11N20SISO	Ant1	High	5825	5875~5925	-46.88	≤-25.31	PASS
11N20SISO	Ant1	High	5825	5925~5935	-46.73	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-19.01	≤18.81	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-21.16	≤15.01	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-44.61	≤-25.41	PASS
11N40SISO	Ant1	Low	5755	5645~5650	-41.93	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-35.41	≤19.42	PASS
11N40SISO	Ant1	High	5795	5855~5875	-37.22	≤12.74	PASS
11N40SISO	Ant1	High	5795	5875~5925	-48.34	≤-26.71	PASS
11N40SISO	Ant1	High	5795	5925~5935	-46.75	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-26.5	≤17.13	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-28.74	≤15.43	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-44.31	≤-25.93	PASS
11AC20SISO	Ant1	Low	5745	5645~5650	-44.8	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-29.33	≤18.80	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-31.51	≤15.50	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-47	≤-26.41	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-47.31	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-20.33	≤16.97	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-21.52	≤15.16	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-44.7	≤-26.10	PASS
11AC40SISO	Ant1	Low	5755	5645~5650	-43.93	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-38.3	≤16.03	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-35.64	≤15.42	PASS

11AC40SISO	Ant1	High	5795	5875~5925	-48.21	≤-26.83	PASS
11AC40SISO	Ant1	High	5795	5925~5935	-47.73	≤-27	PASS
11AC80SISO	Ant1	Low	5775	5720~5725	-17.54	≤20.24	PASS
11AC80SISO	Ant1	Low	5775	5700~5720	-19.86	≤12.78	PASS
11AC80SISO	Ant1	Low	5775	5650~5700	-37.31	≤-26.57	PASS
11AC80SISO	Ant1	Low	5775	5645~5650	-36.63	≤-27	PASS
11AC80SISO	Ant1	High	5775	5850~5855	-27.7	≤17.53	PASS
11AC80SISO	Ant1	High	5775	5855~5875	-28.29	≤14.85	PASS
11AC80SISO	Ant1	High	5775	5875~5925	-44.65	≤-26.73	PASS
11AC80SISO	Ant1	High	5775	5925~5935	-43.25	≤-27	PASS

Note: Offset=cable loss+Antenna gain, Gain=1.5dBi


Test Graphs B1

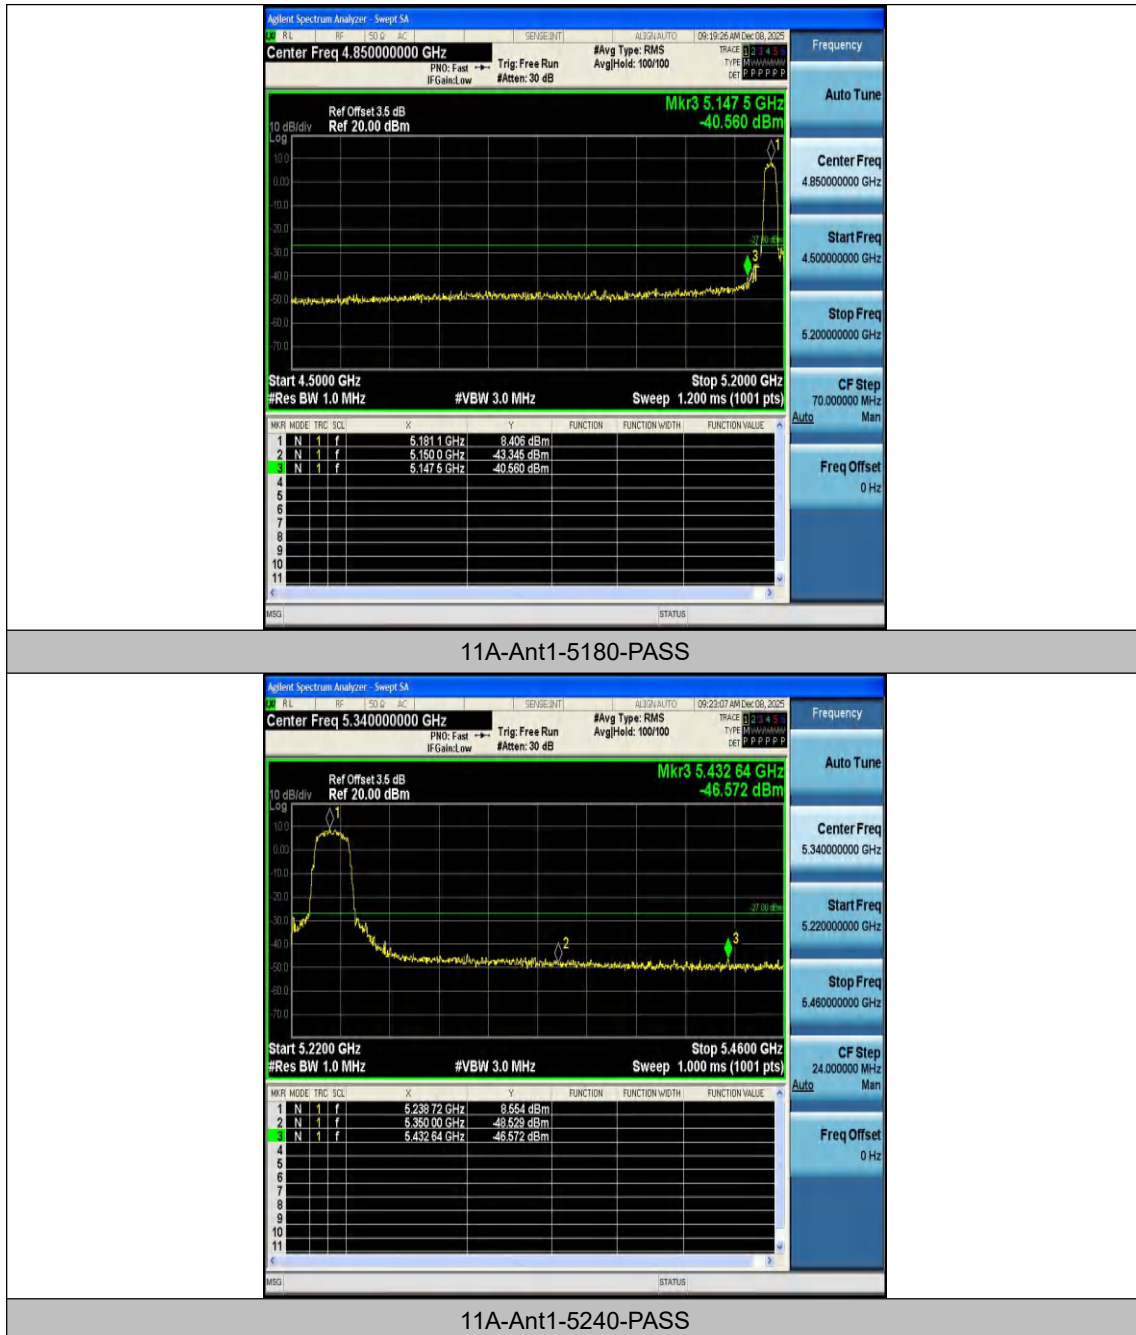



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

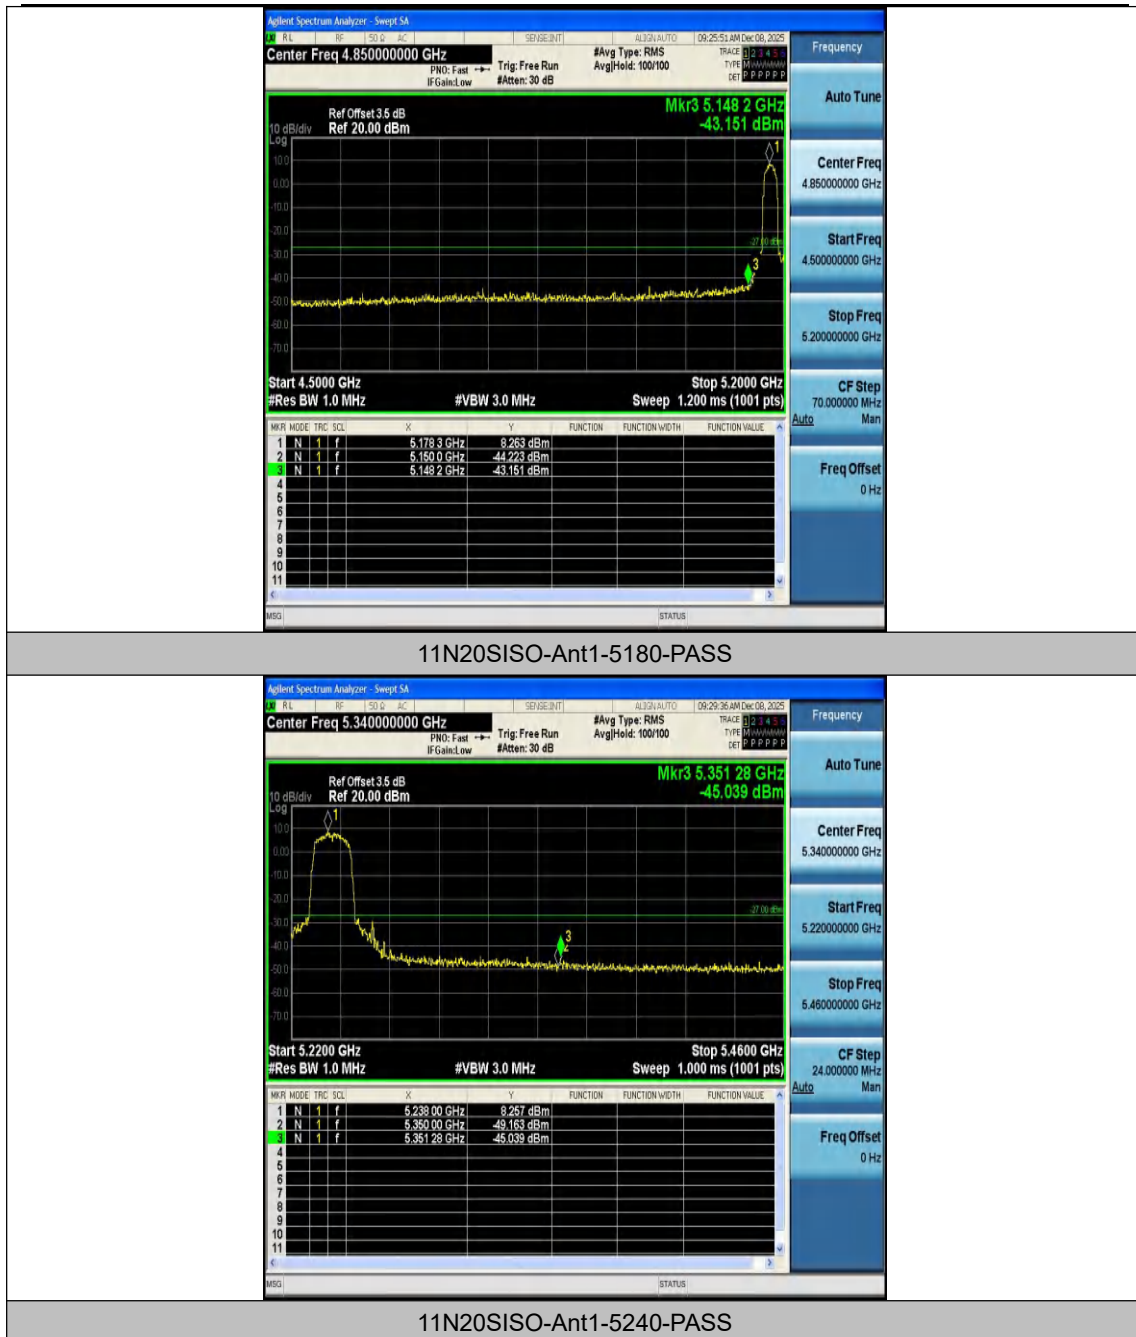

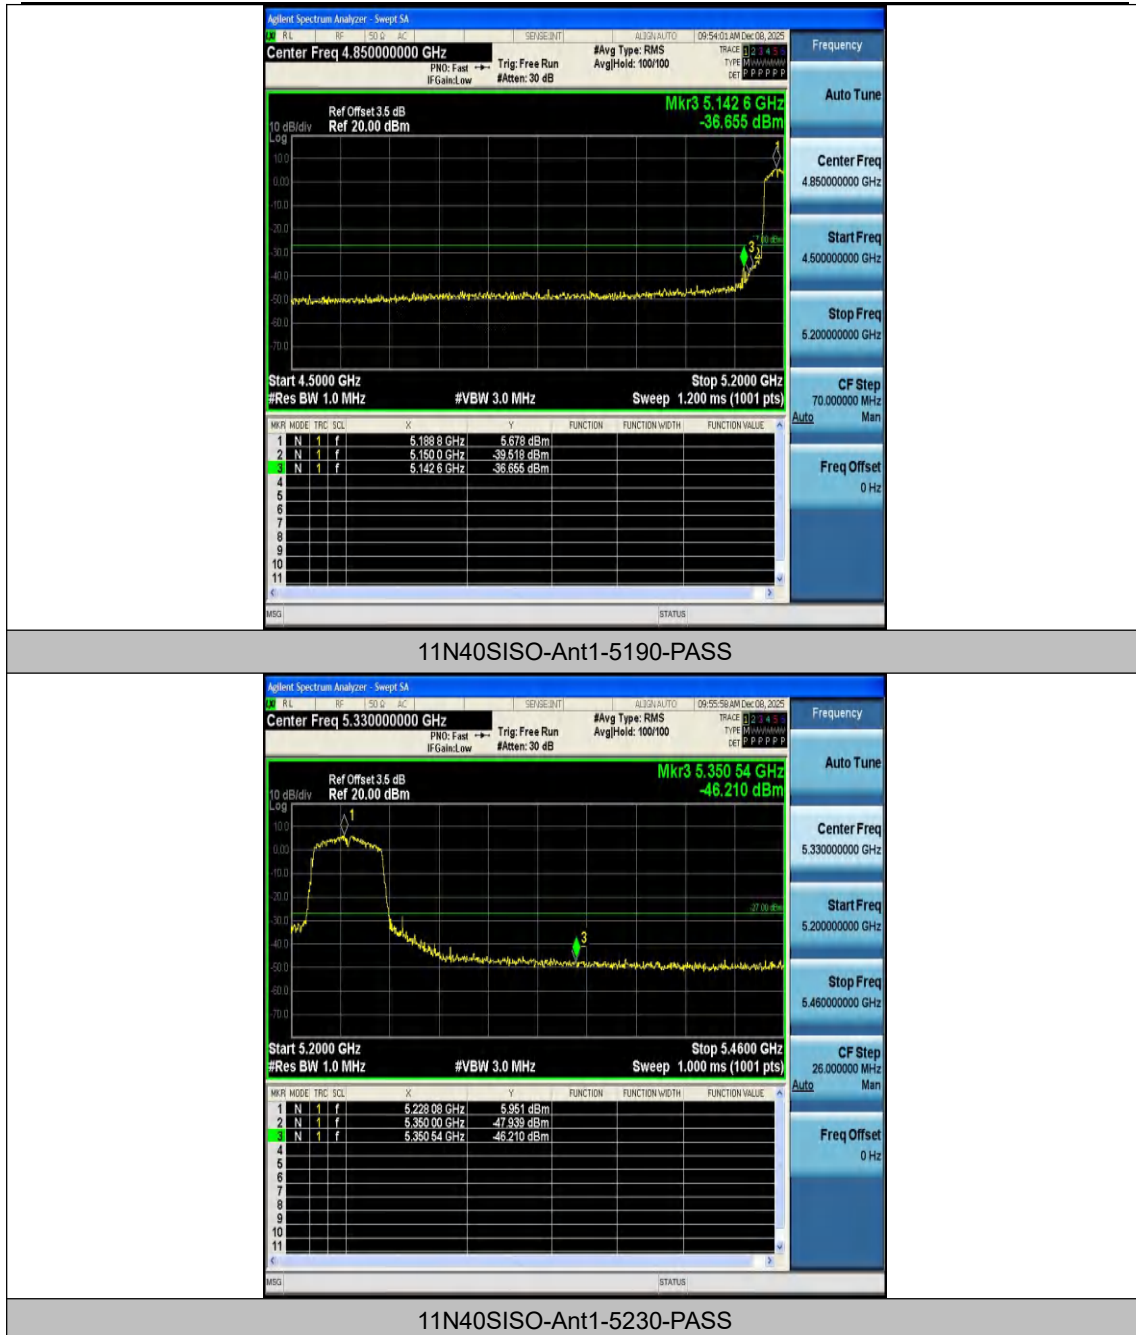


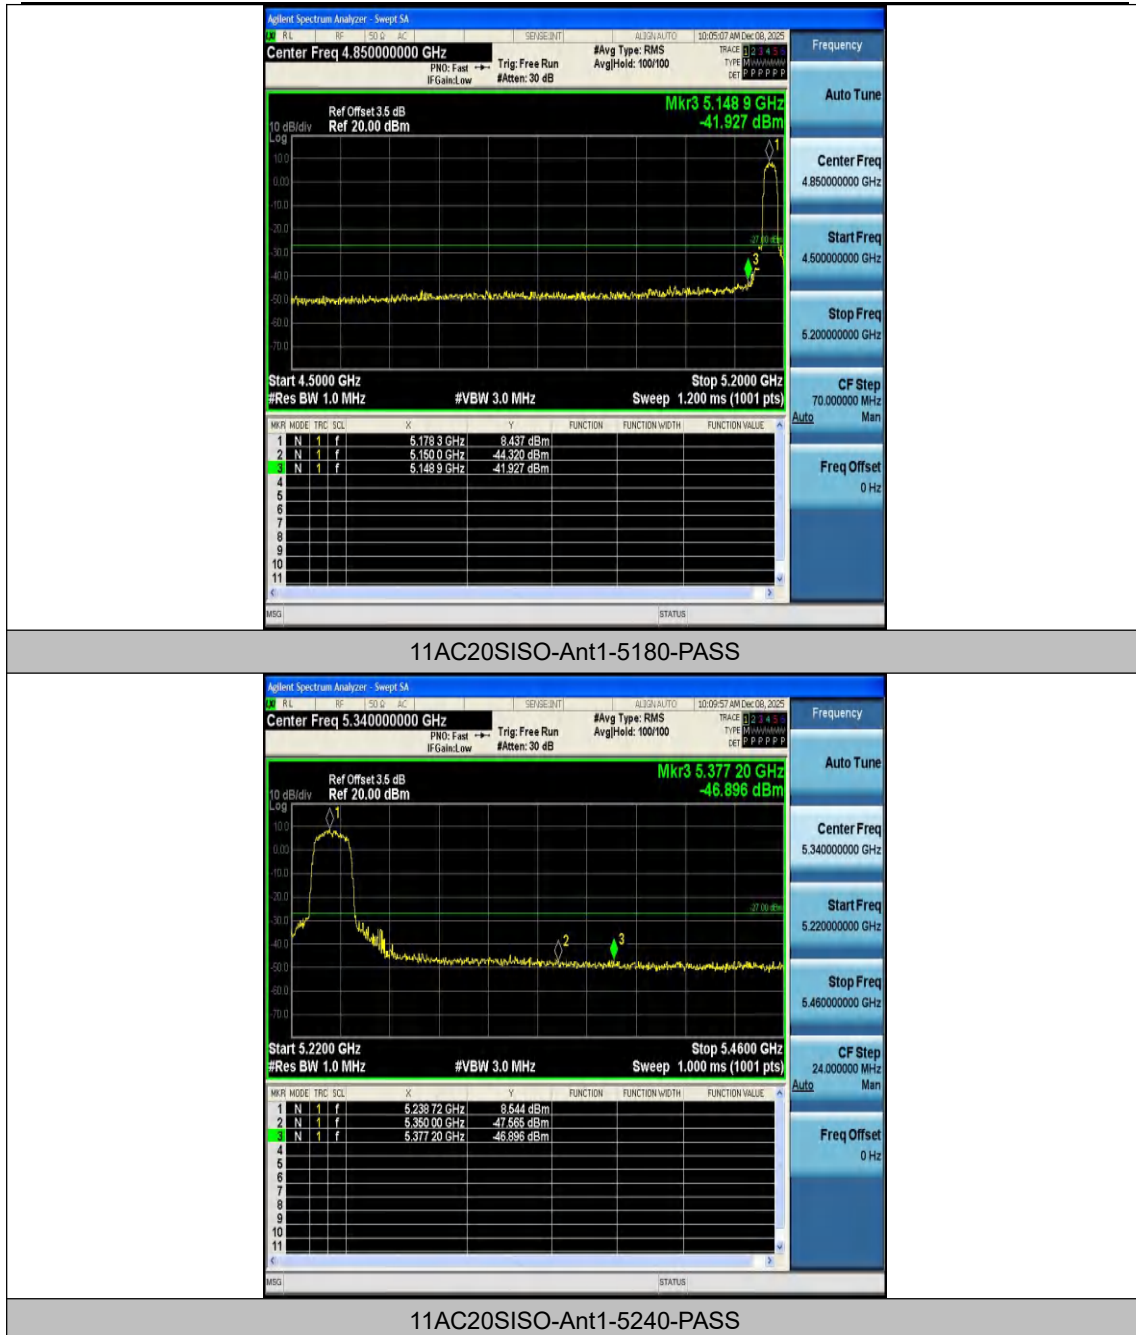


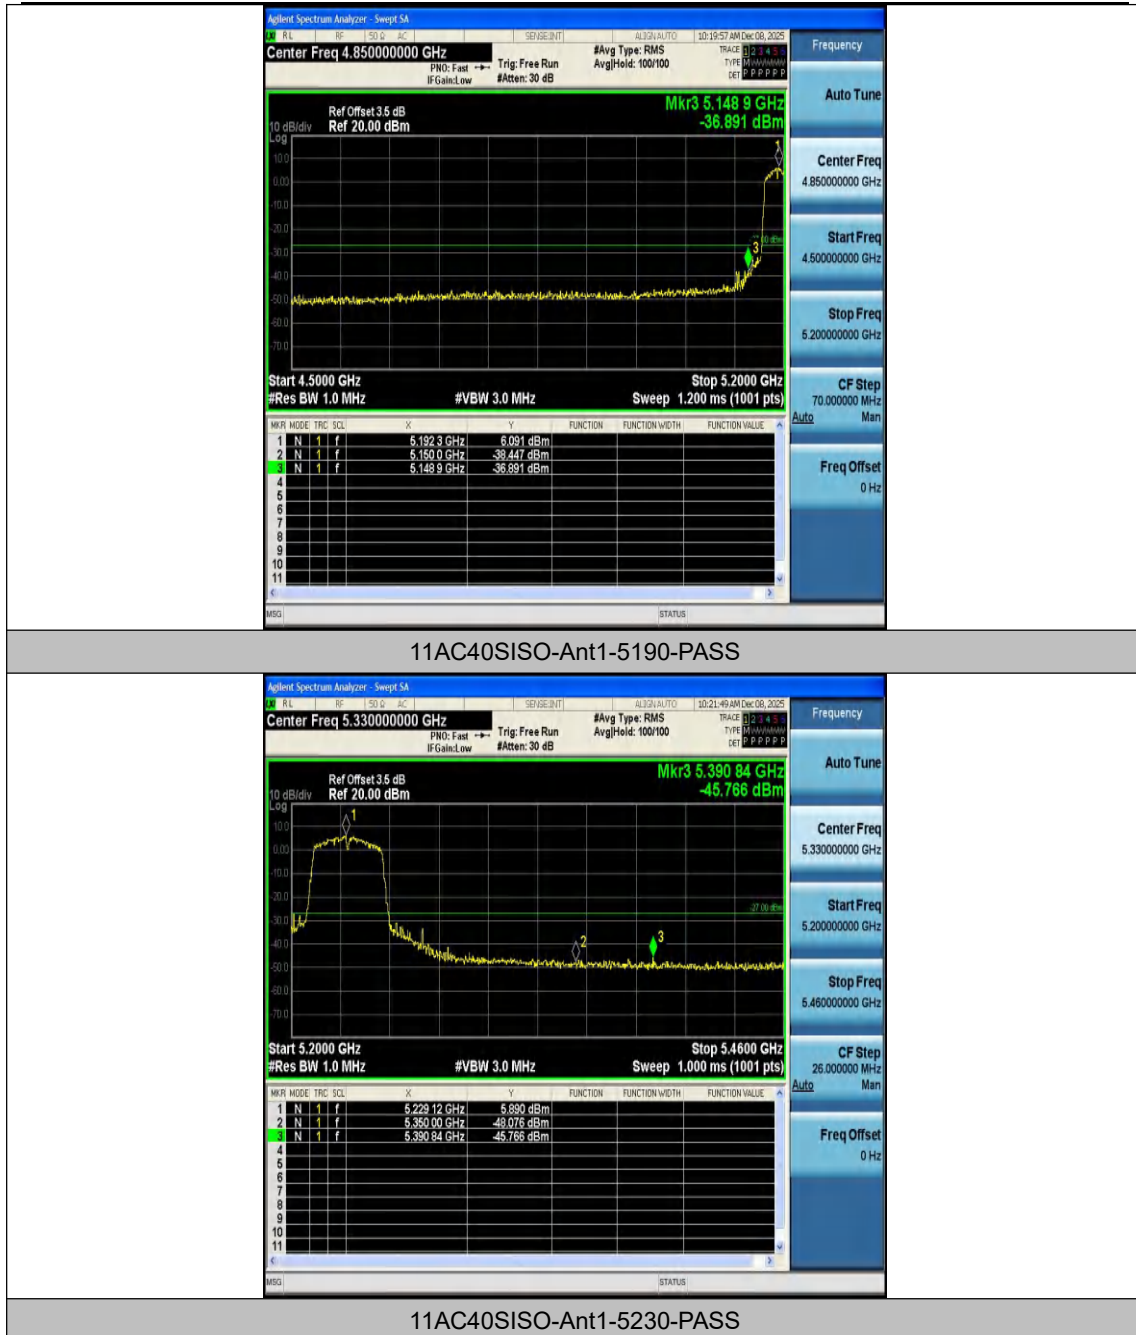

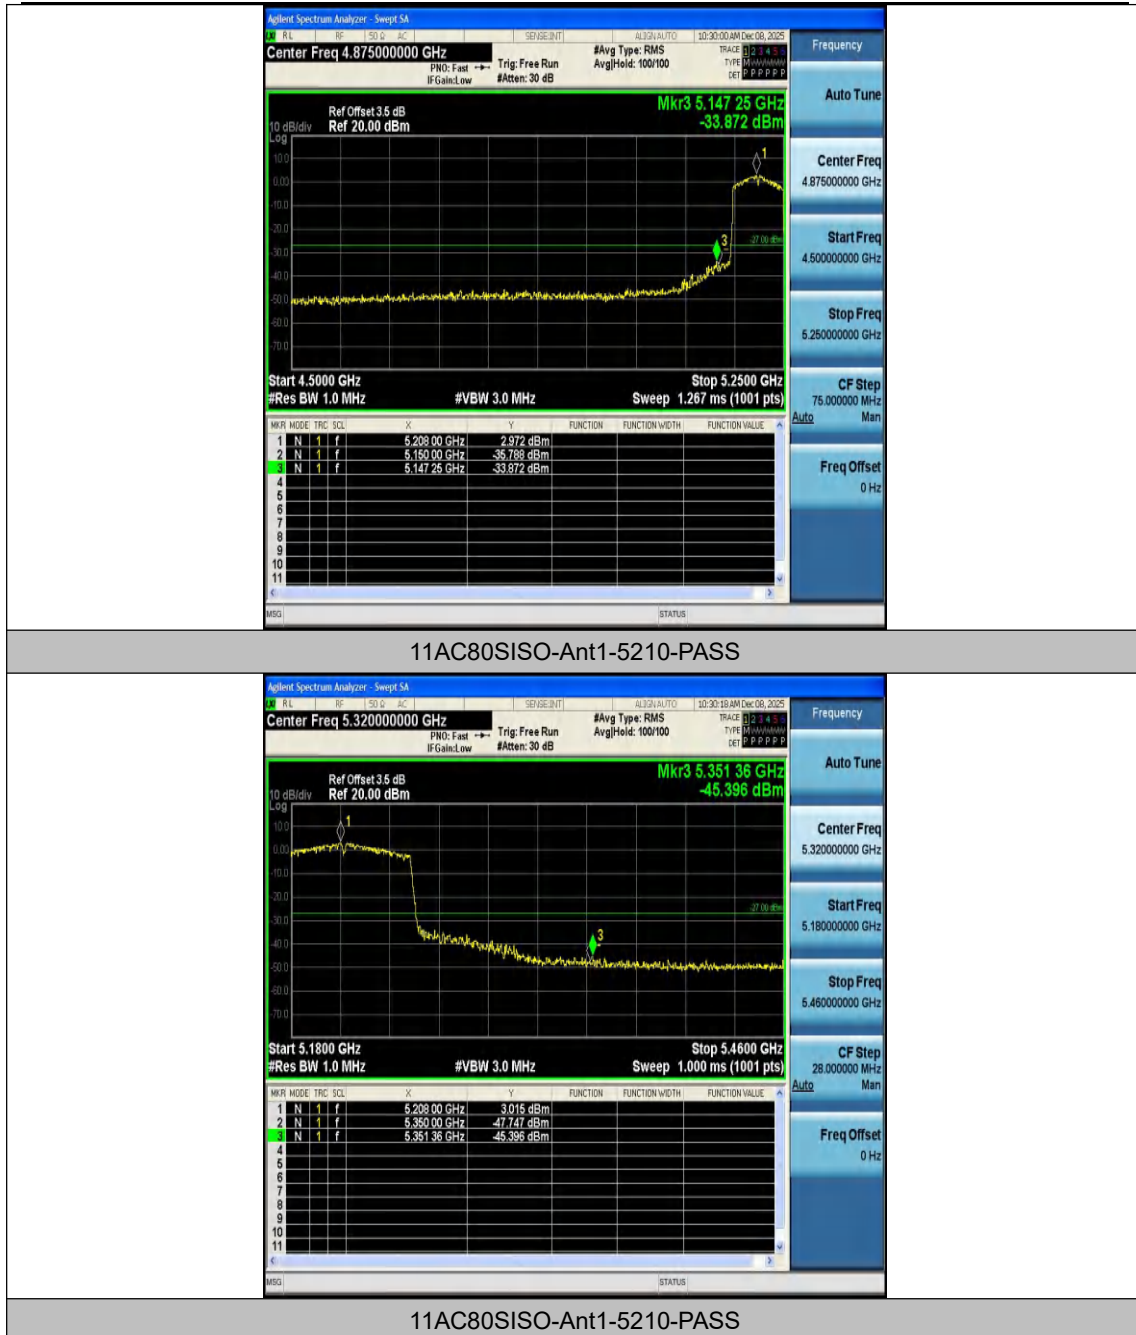

Test Graphs B4

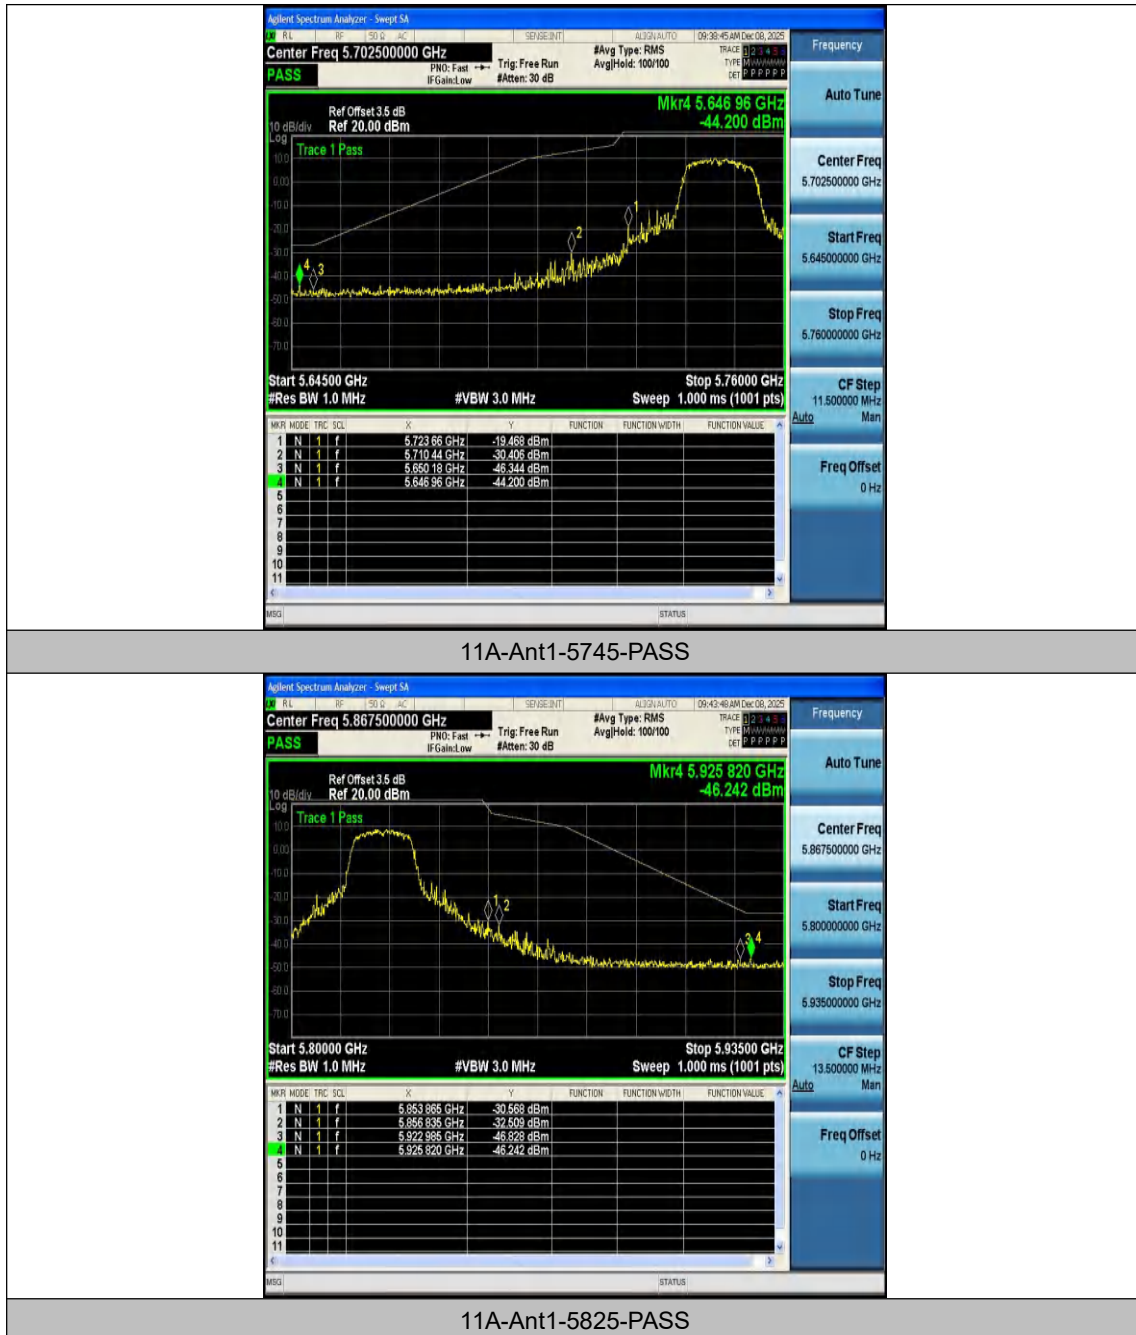

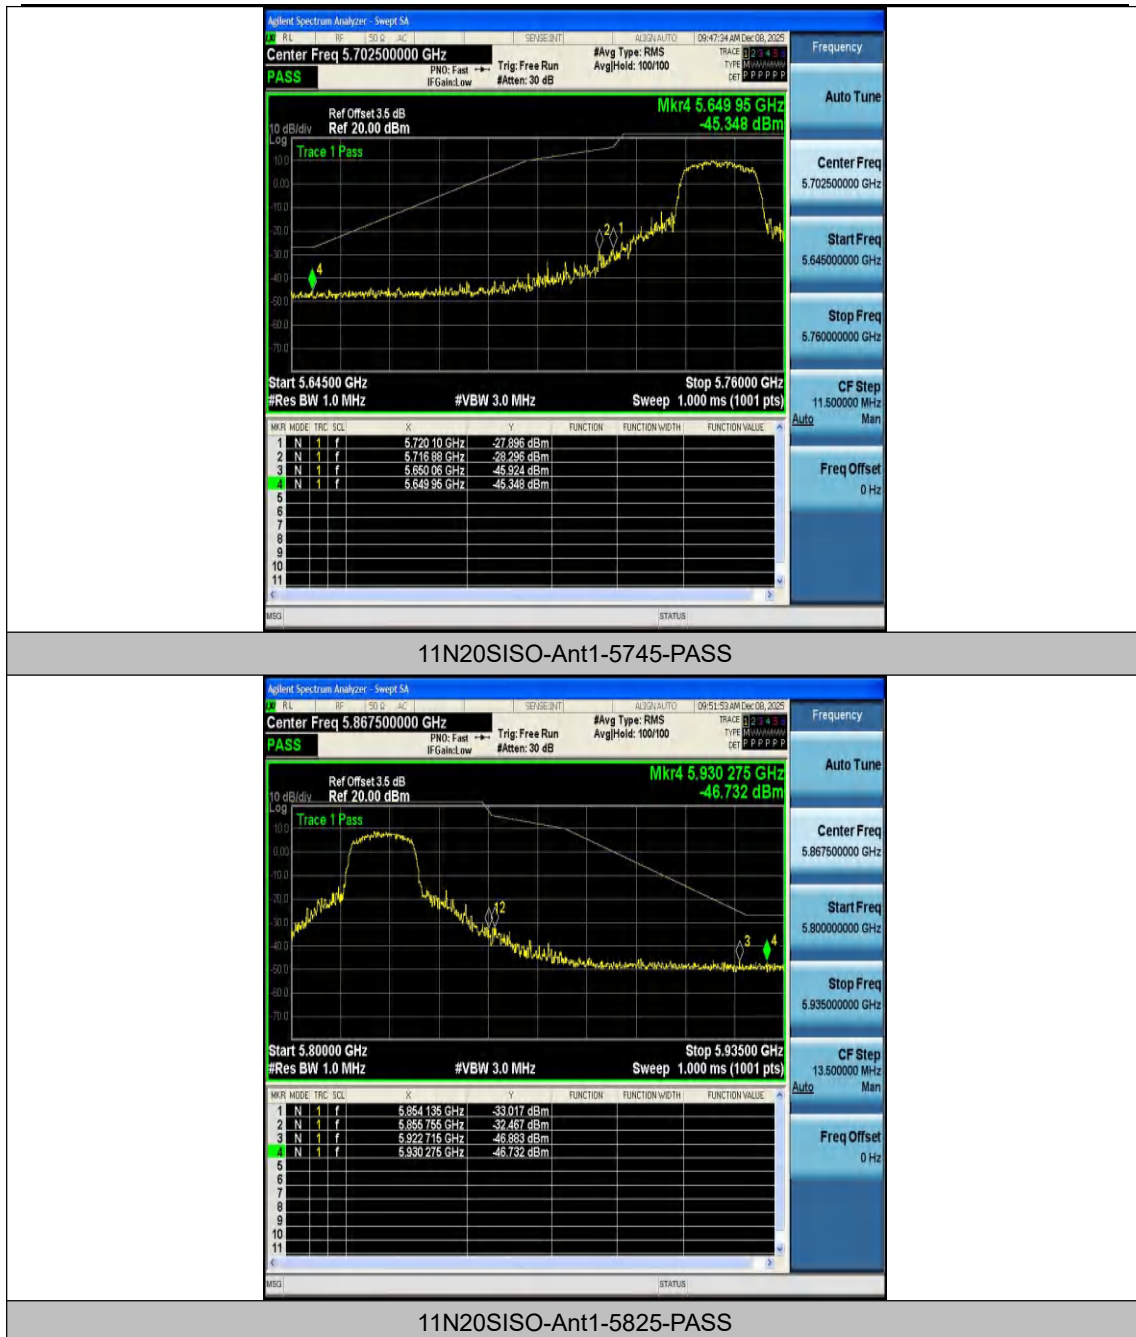




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

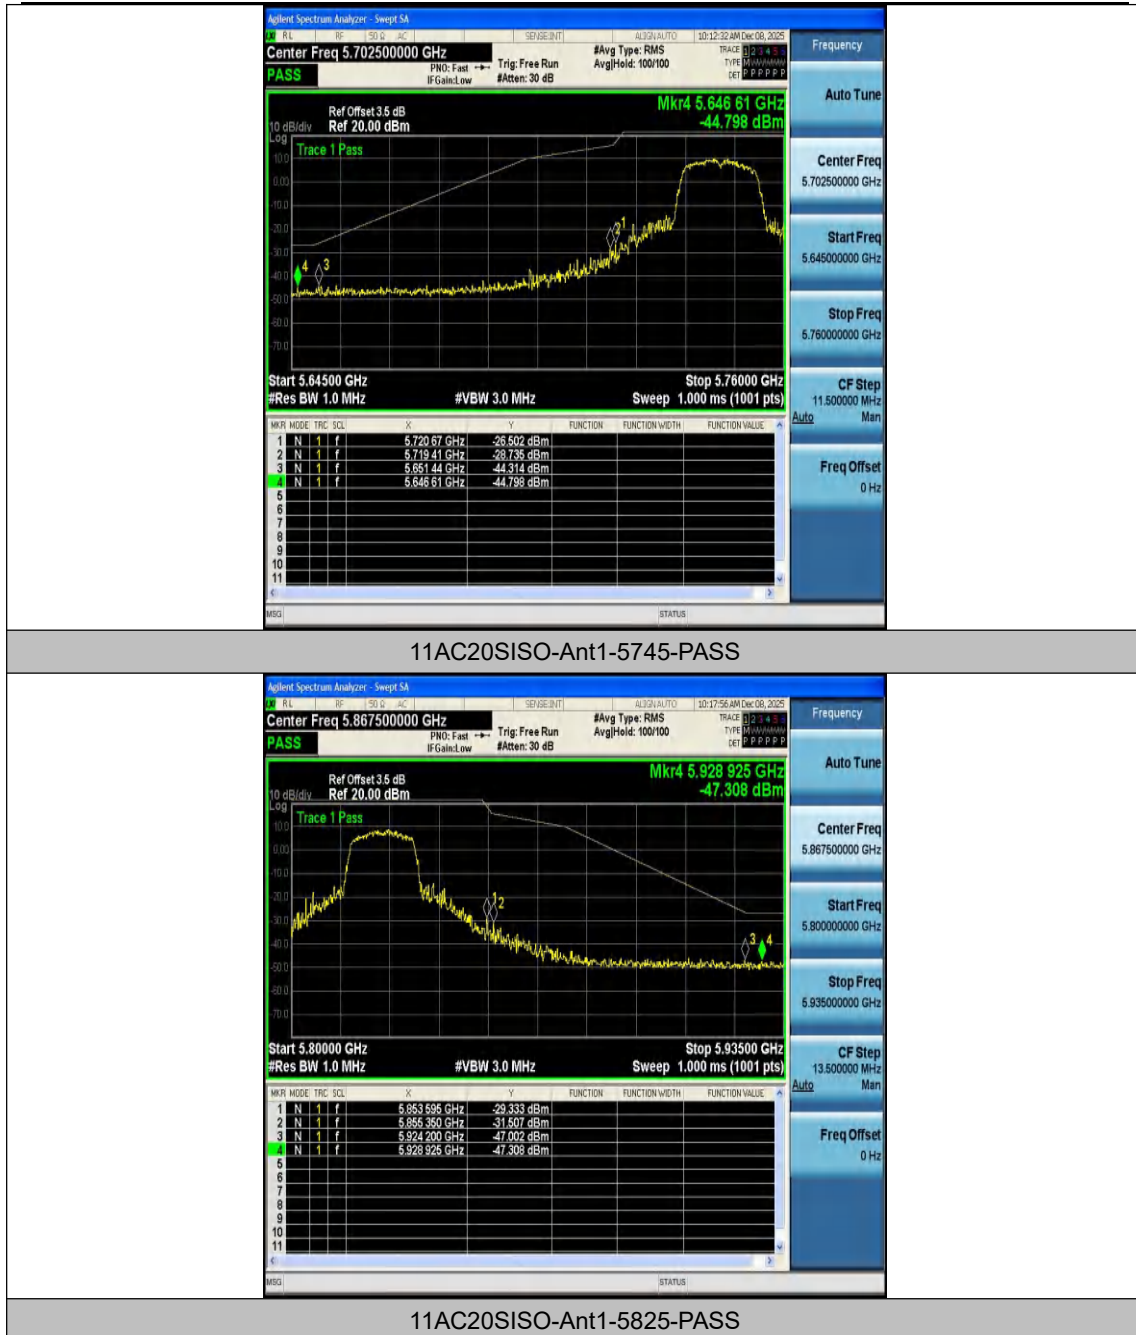


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



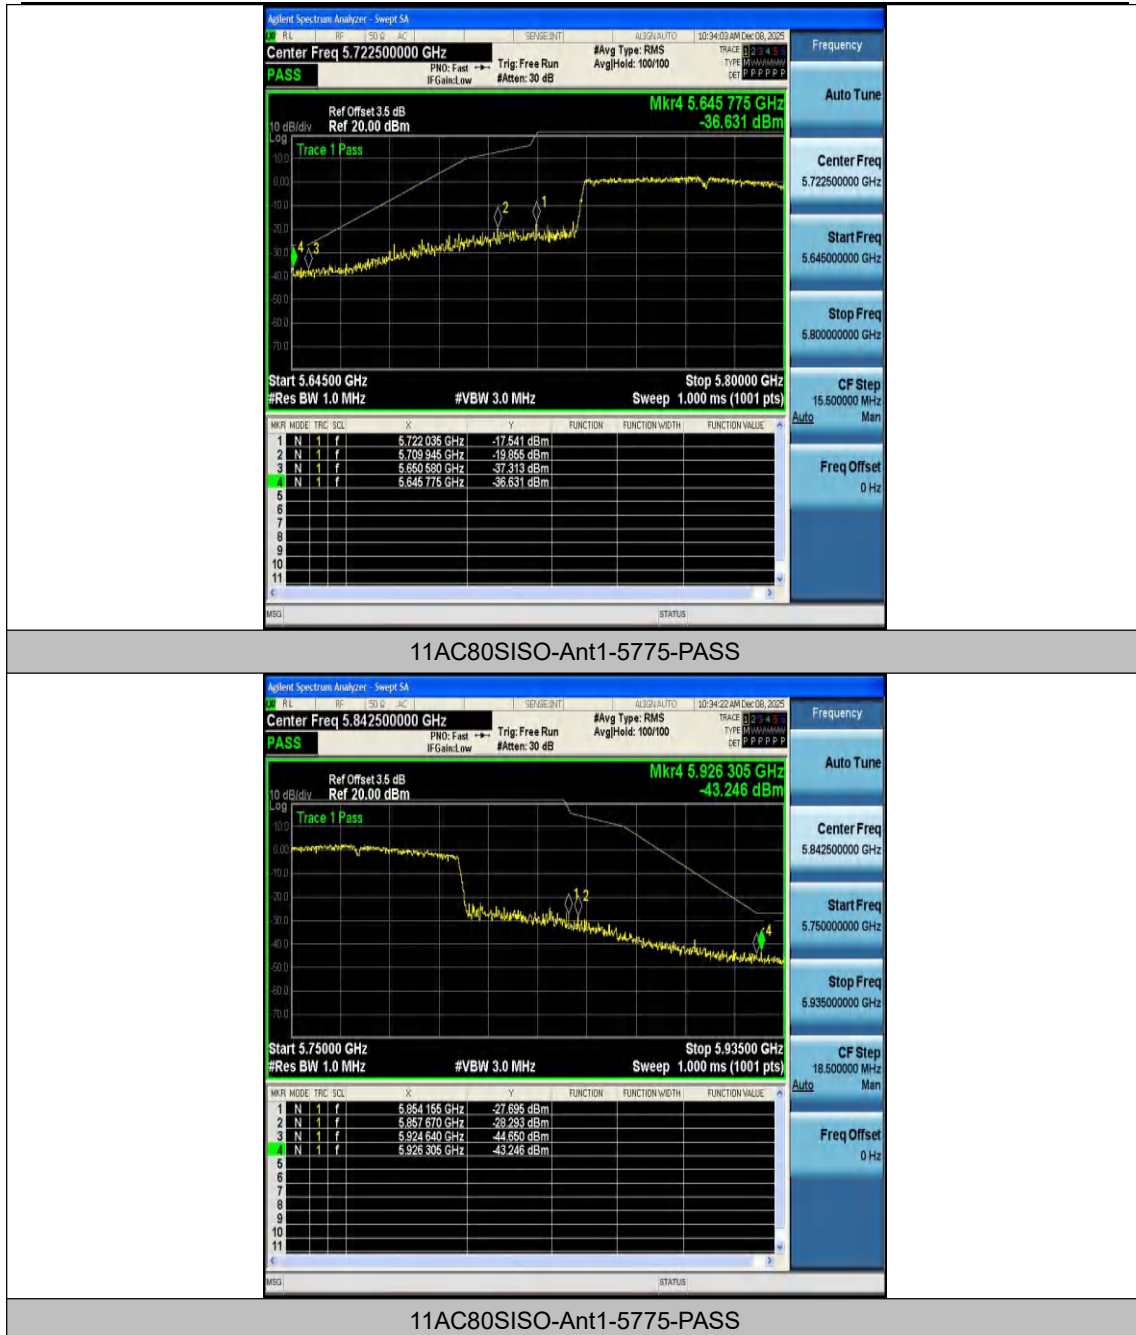

---END---