



**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

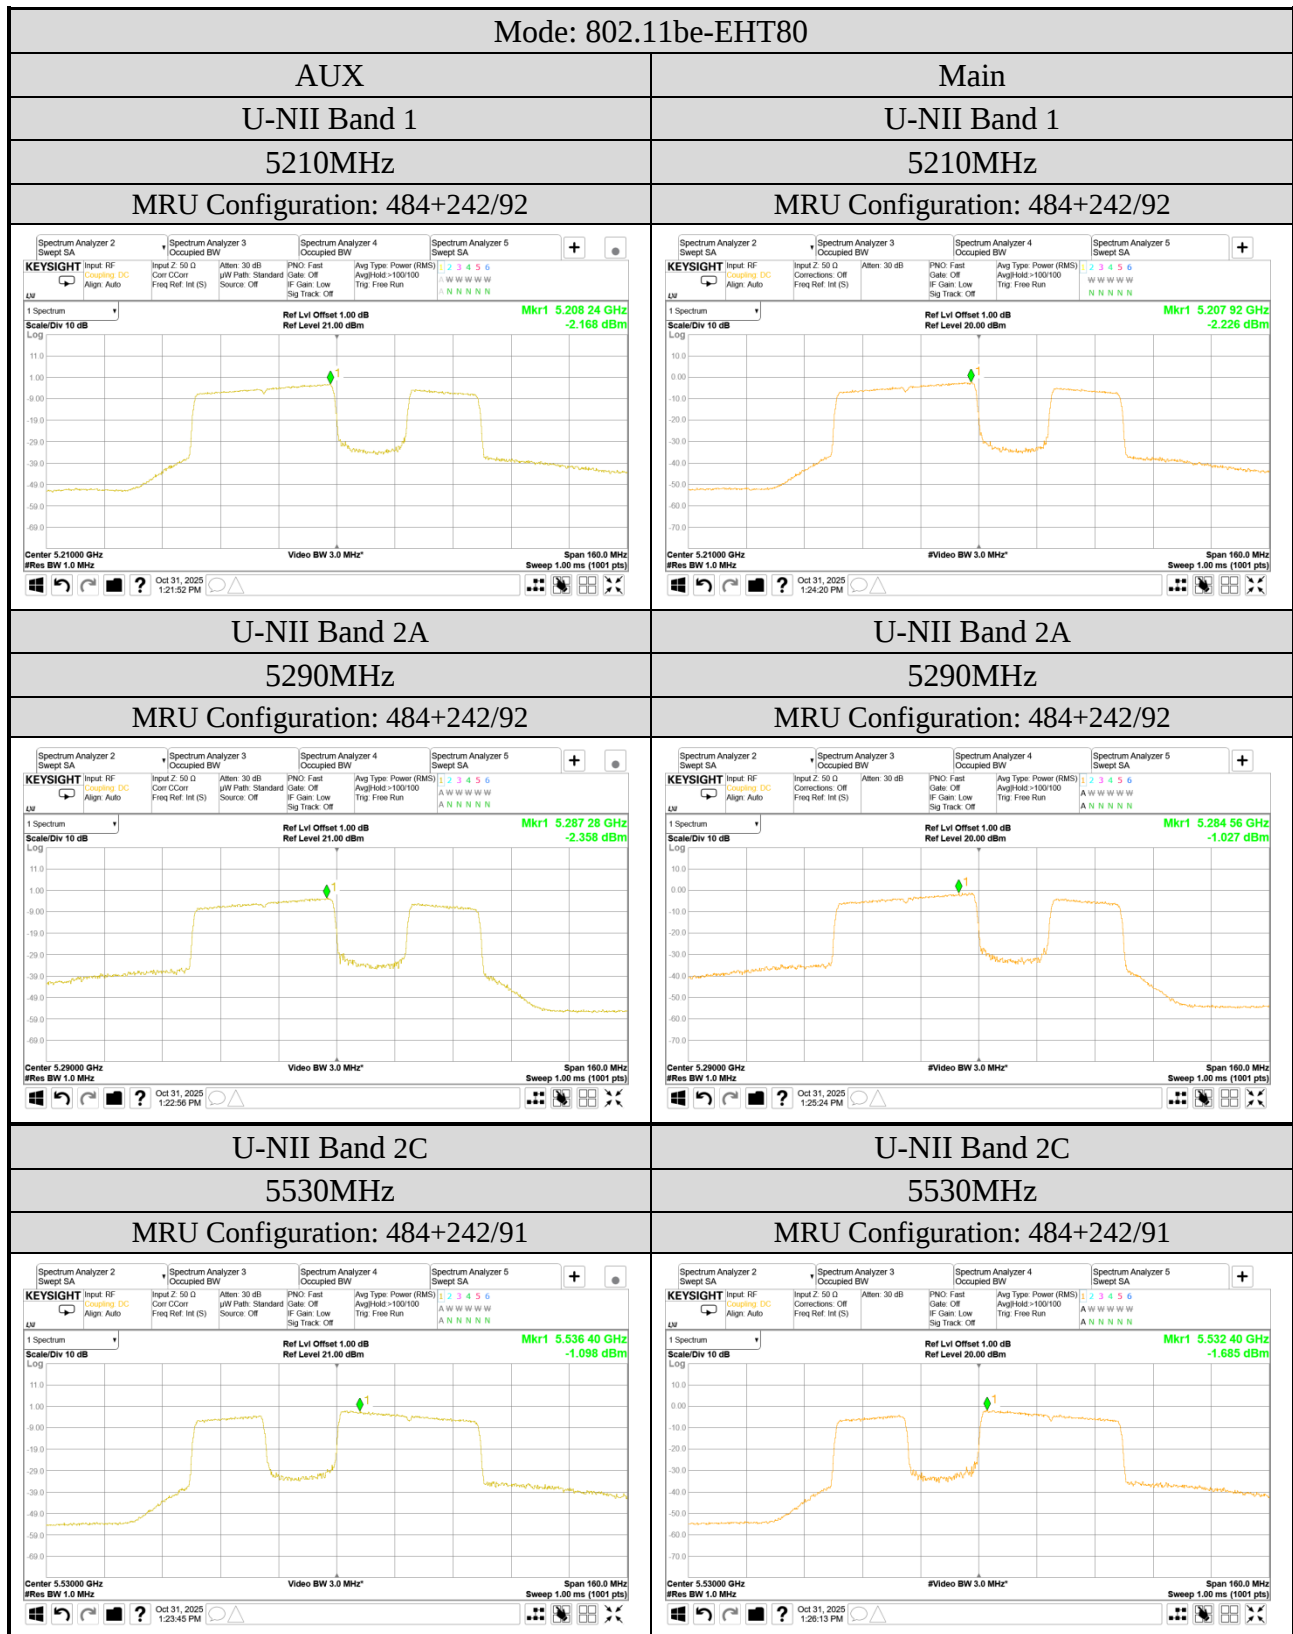


**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

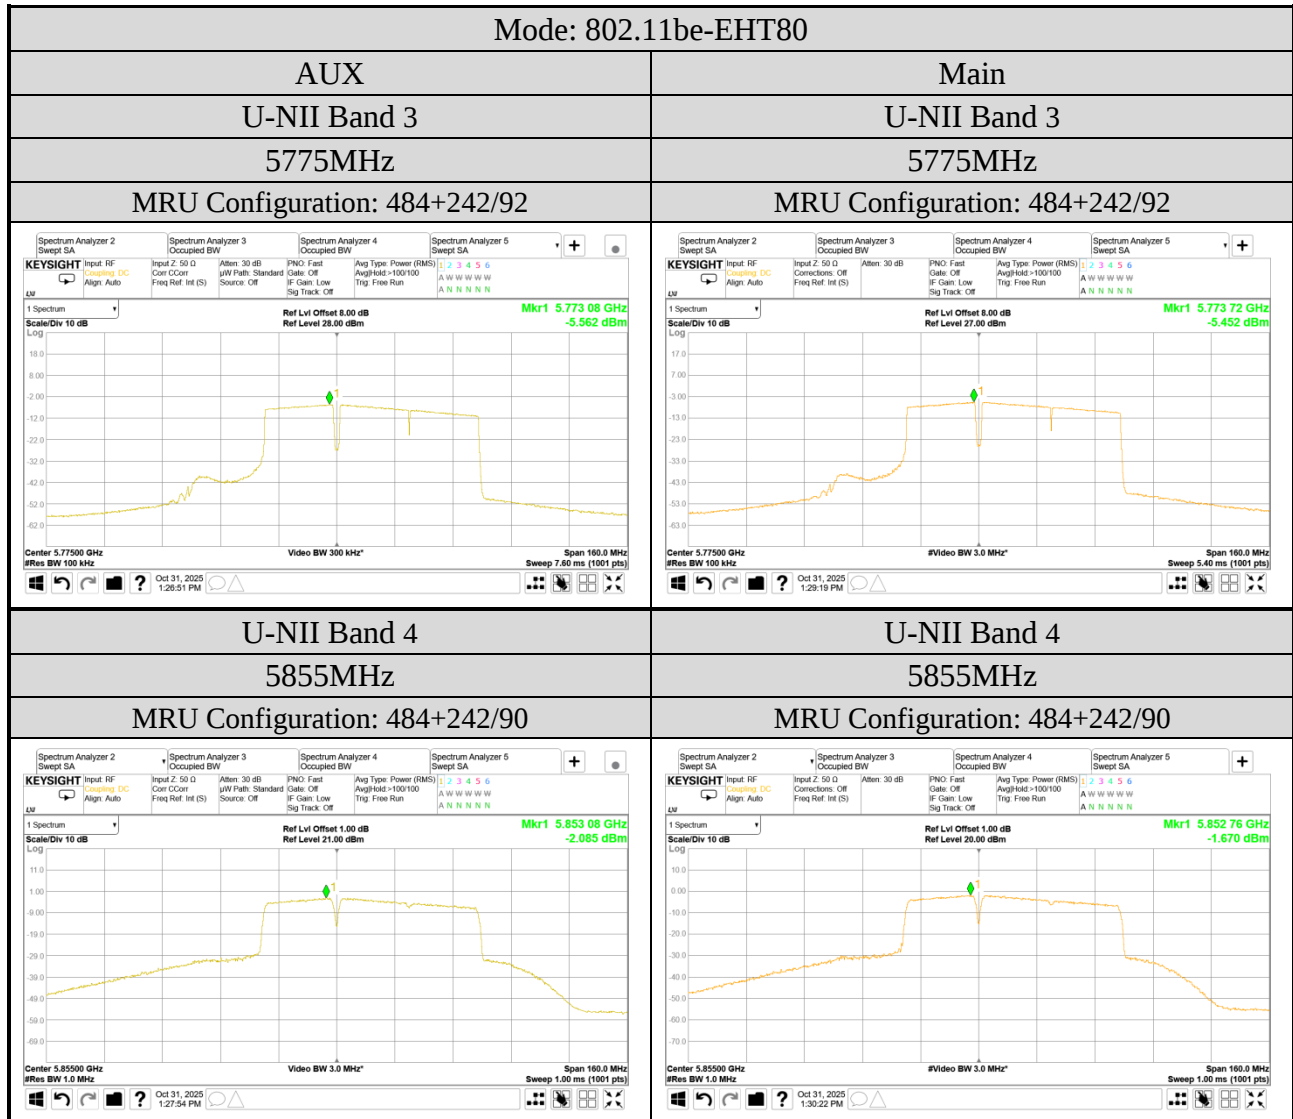

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

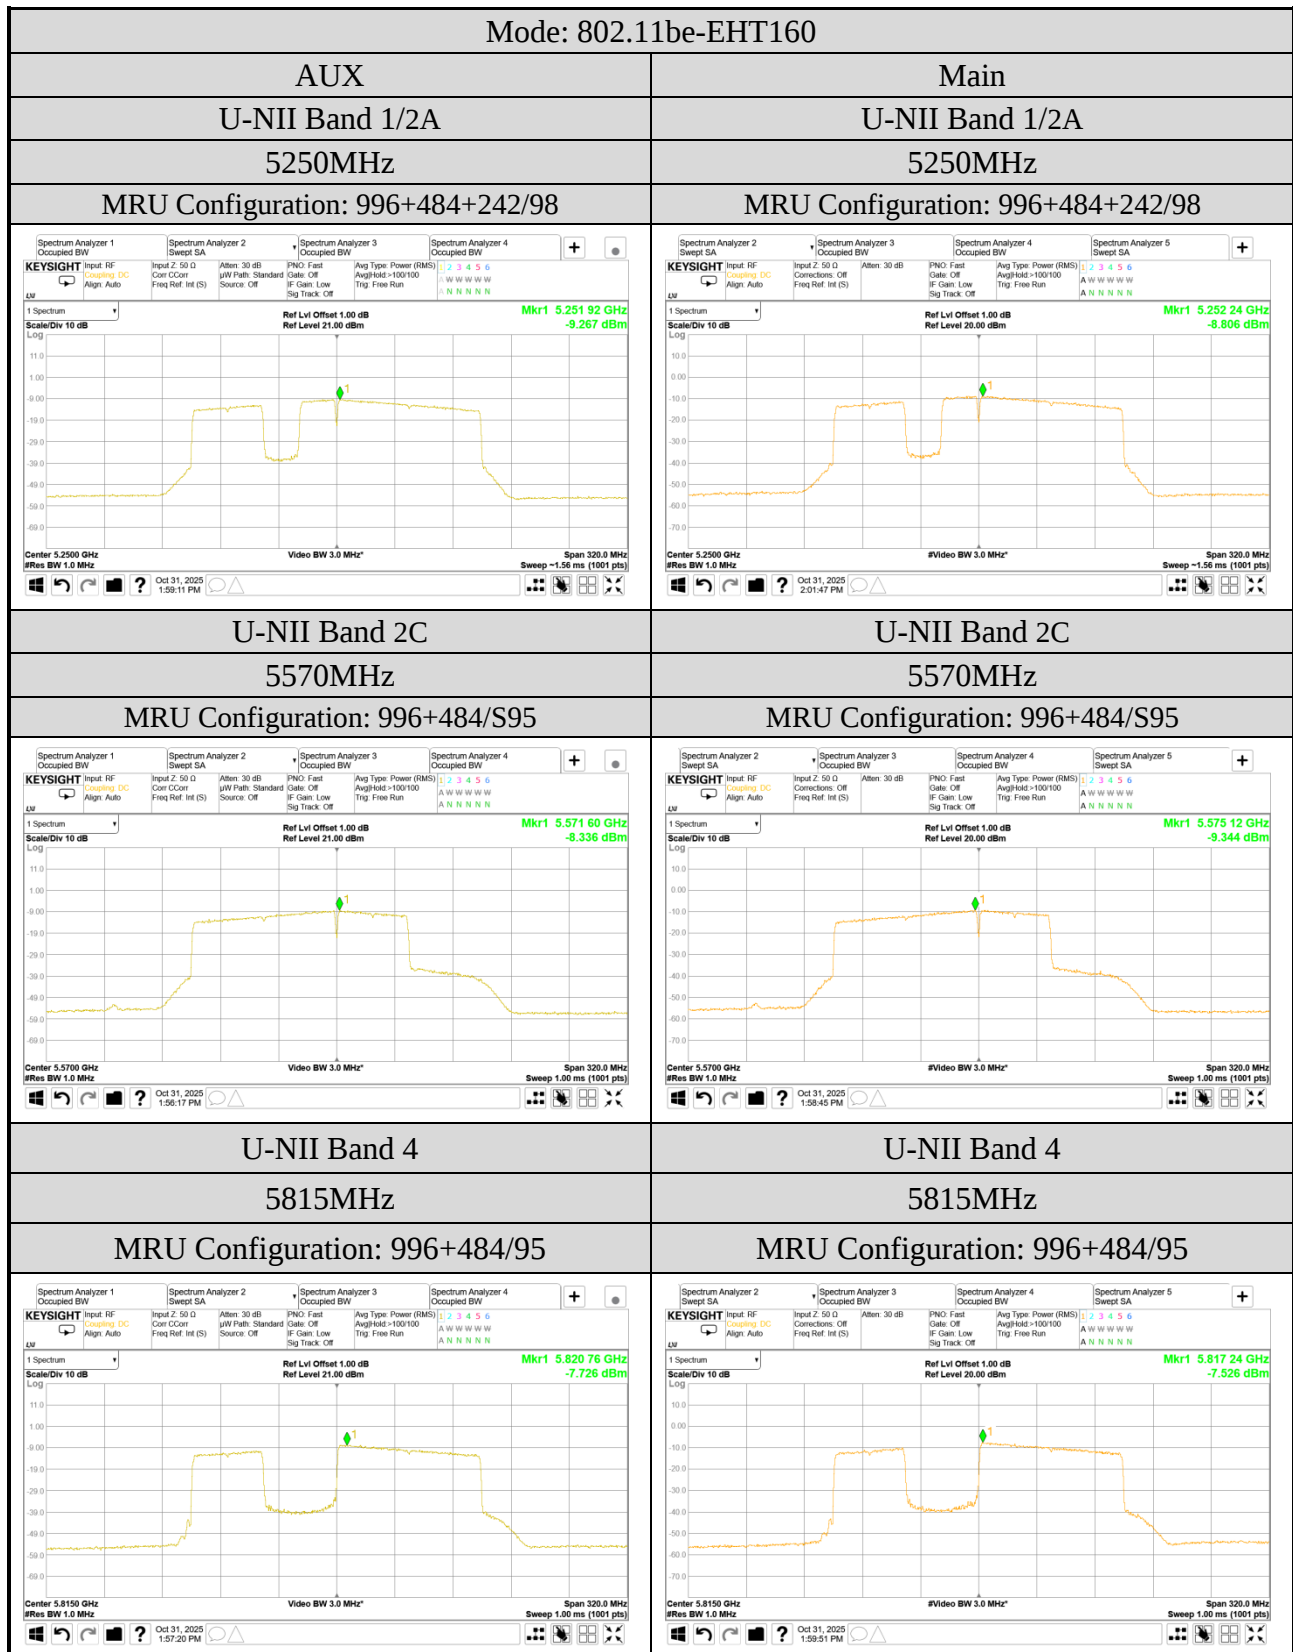

## A.5 FREQUENCY STABILITY

|              |                               |            |             |
|--------------|-------------------------------|------------|-------------|
| Test Date    | 2025/10/03                    | Temp./Hum. | 25°C/55%    |
| Cable Loss   | ---                           | Tested By  | Harry Huang |
| Test Voltage | AC 120V 60Hz (Via AC Adapter) |            |             |

### A.5.1 Frequency stability Result


| Temperature (°C) | Voltage (Vac) | Centre Frequency (MHz) | Measurement Value (MHz) | Frequency Stability (ppm) |
|------------------|---------------|------------------------|-------------------------|---------------------------|
| 25               | 120           | 5180                   | 5180.001                | 0.193                     |
| -30              | 102           |                        | 5179.996                | -0.772                    |
|                  | 138           |                        | 5179.999                | -0.193                    |
| -20              | 102           |                        | 5179.997                | -0.579                    |
|                  | 138           |                        | 5180.004                | 0.772                     |
| -10              | 102           |                        | 5180.002                | 0.386                     |
|                  | 138           |                        | 5180.003                | 0.579                     |
| 0                | 102           |                        | 5179.998                | -0.386                    |
|                  | 138           |                        | 5179.996                | -0.772                    |
| 10               | 102           |                        | 5179.999                | -0.193                    |
|                  | 138           |                        | 5180.002                | 0.386                     |
| 20               | 102           |                        | 5179.996                | -0.772                    |
|                  | 138           |                        | 5180.005                | 0.965                     |
| 30               | 102           |                        | 5180.004                | 0.772                     |
|                  | 138           |                        | 5180.004                | 0.772                     |
| 40               | 102           |                        | 5179.998                | -0.386                    |
|                  | 138           |                        | 5180.004                | 0.772                     |
| 50               | 102           |                        | 5180.004                | 0.772                     |
|                  | 138           |                        | 5179.995                | -0.965                    |

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel:** +886 2 26099301  
**Fax:** +886 2 26099303



## A.6 BAND EDGE

|              |                               |            |                    |
|--------------|-------------------------------|------------|--------------------|
| Test Date    | 2025/09/25 ~ 10/07            | Temp./Hum. | 23 ~ 24°C/49 ~ 56% |
| Test Voltage | AC 120V 60Hz (Via AC Adapter) | Tested By  | Harry Huang        |

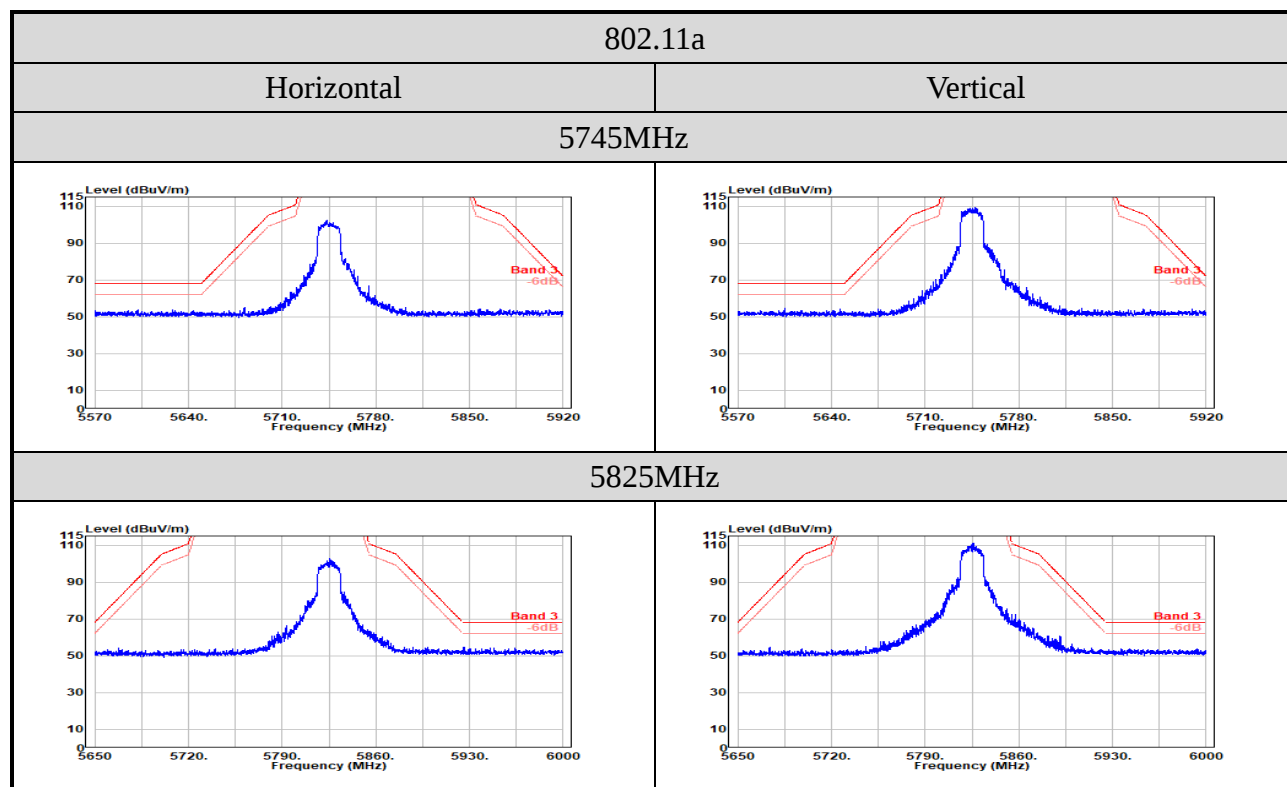



**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City 244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

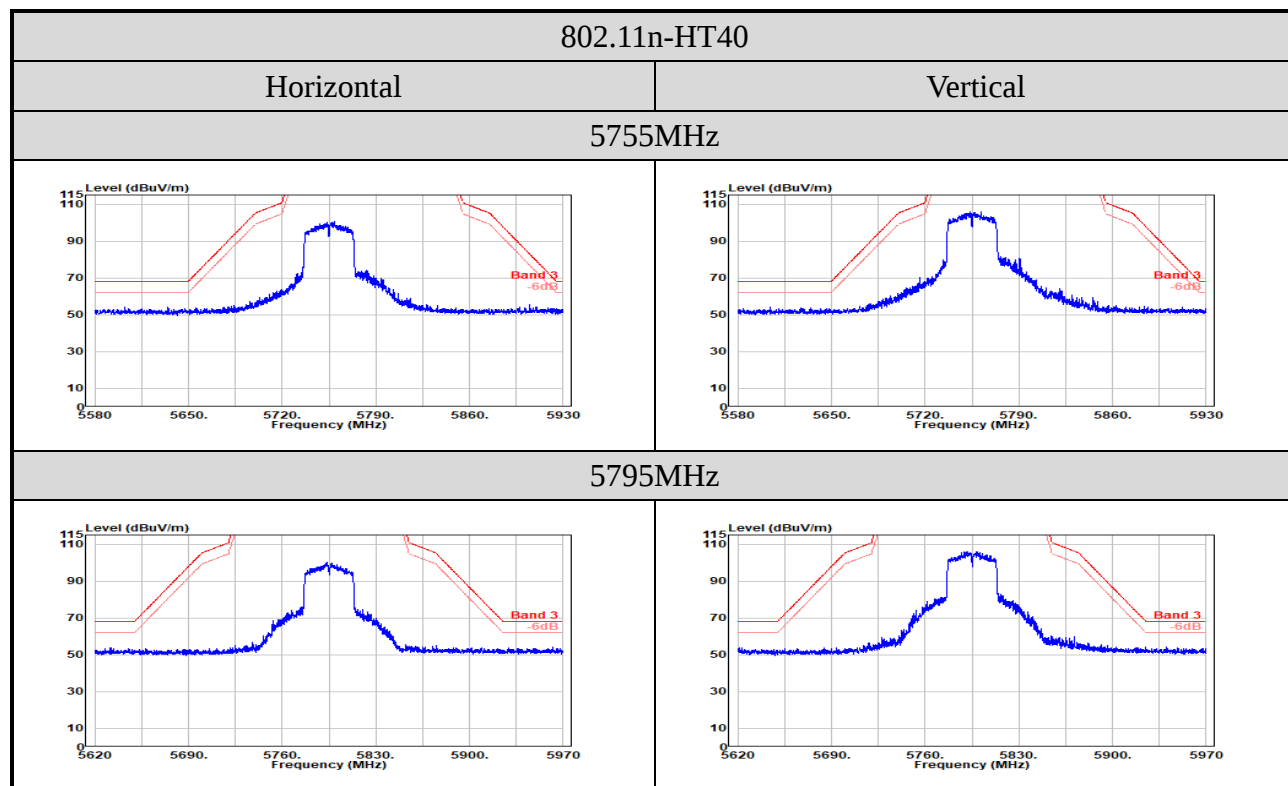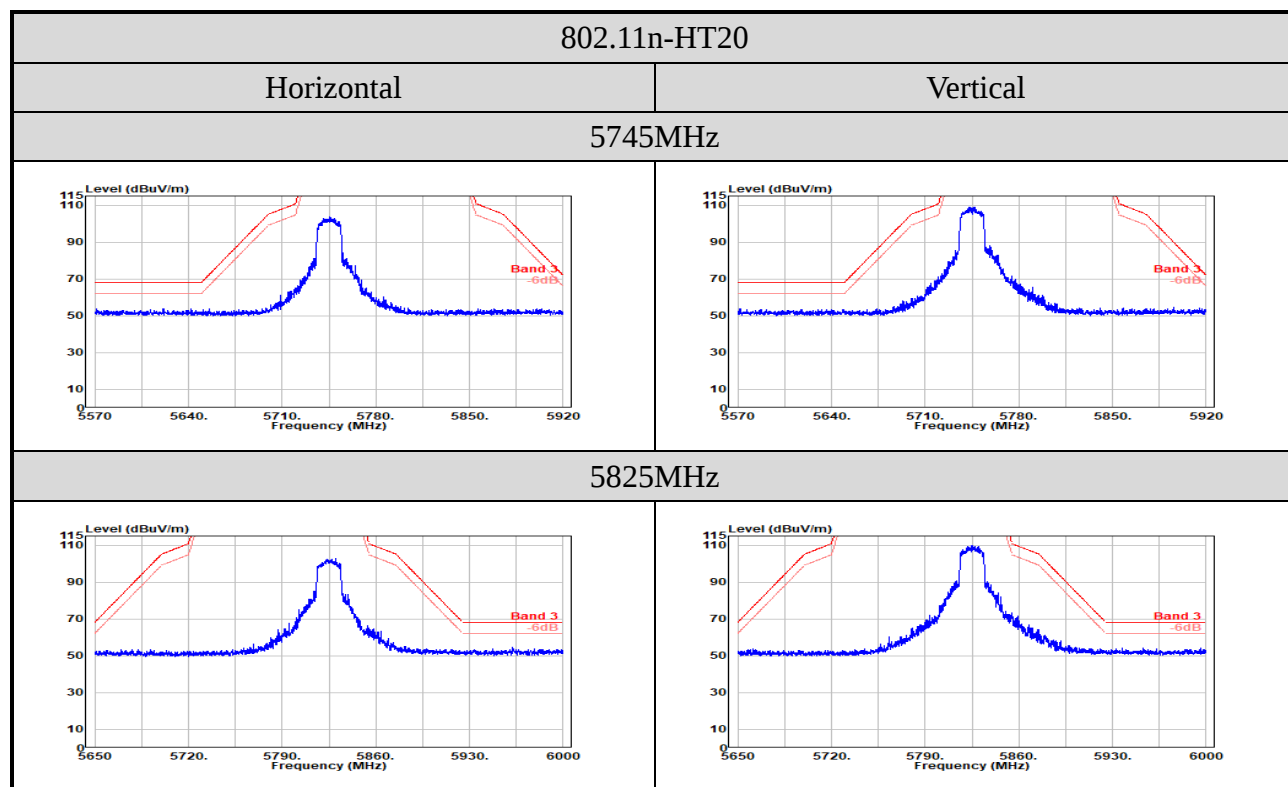



**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan



**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

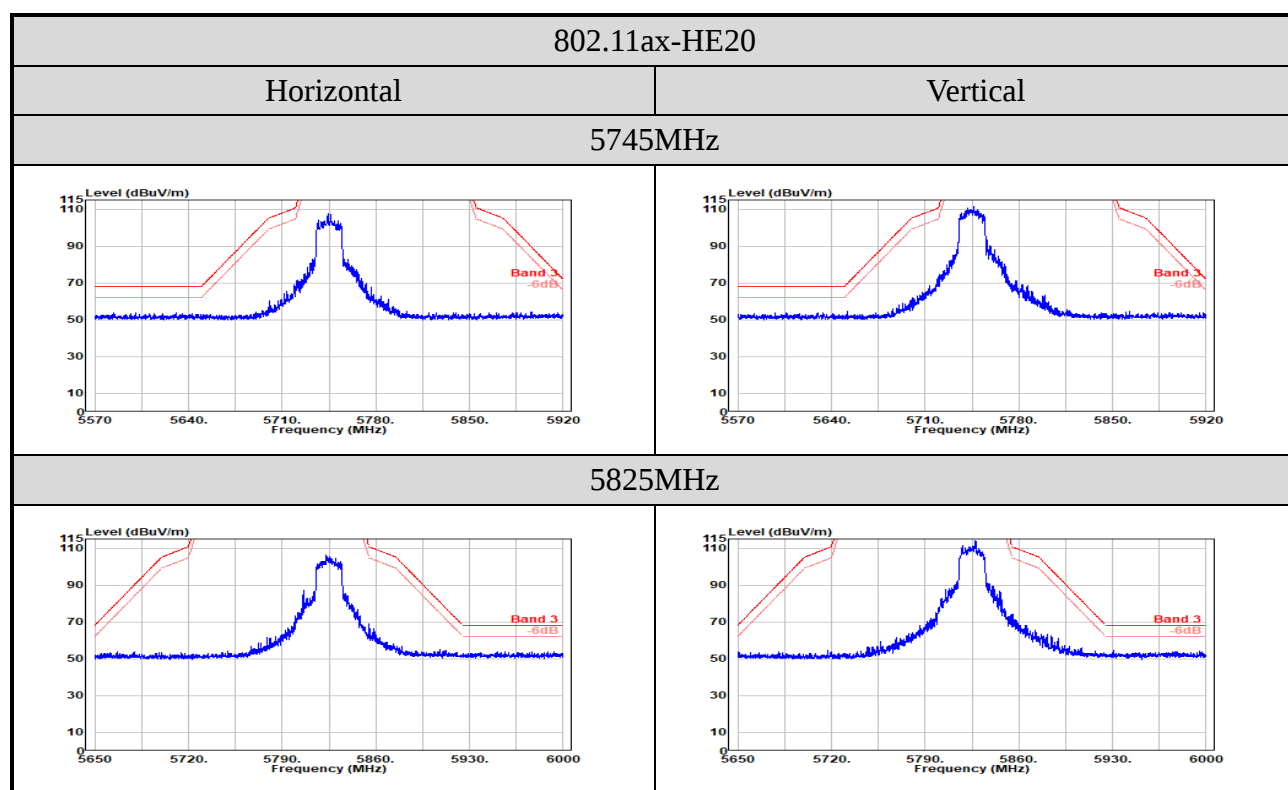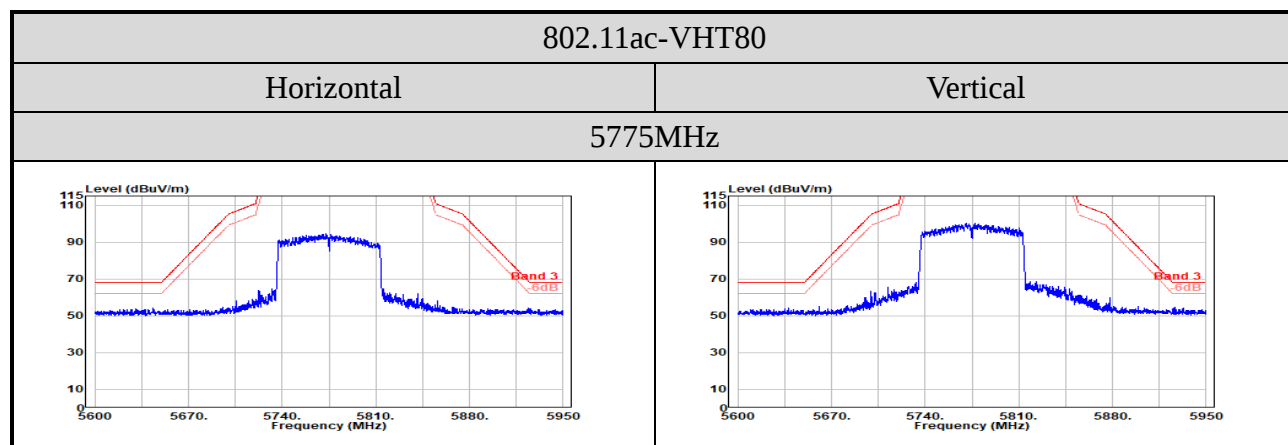

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan


**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

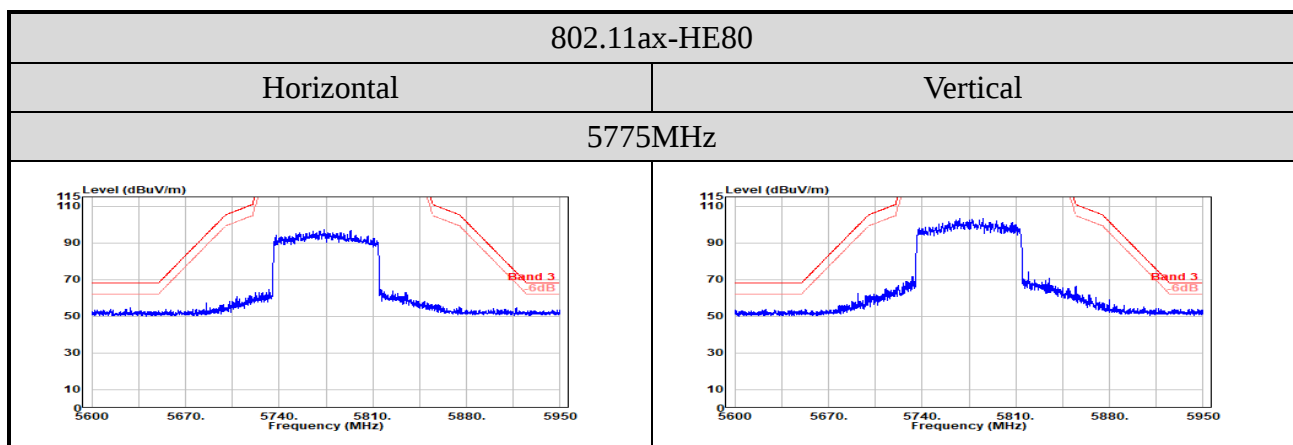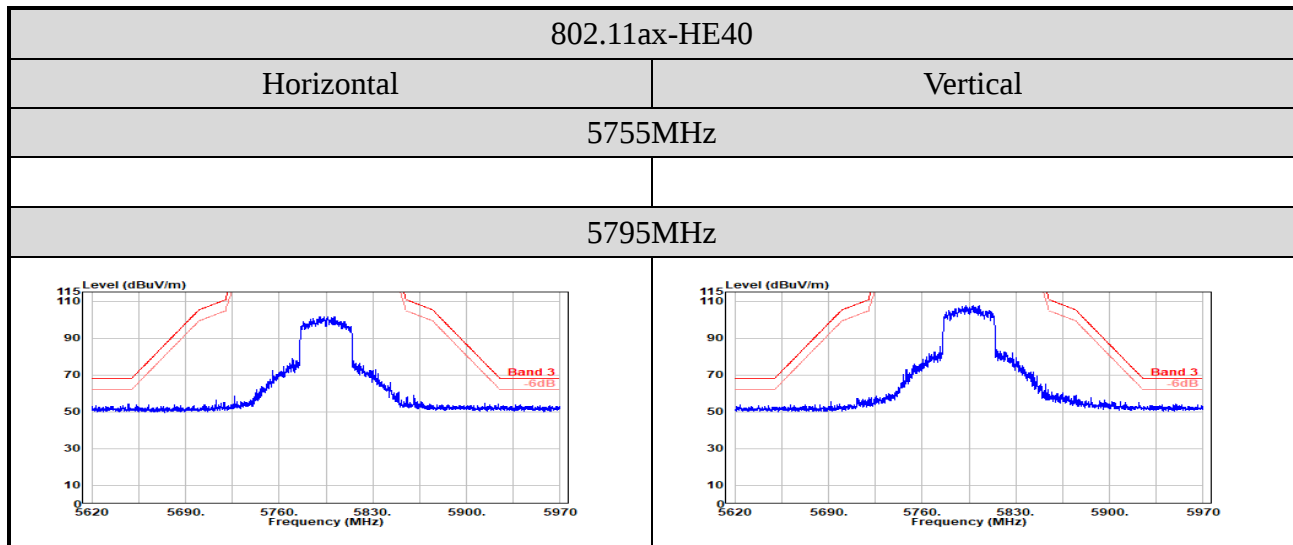

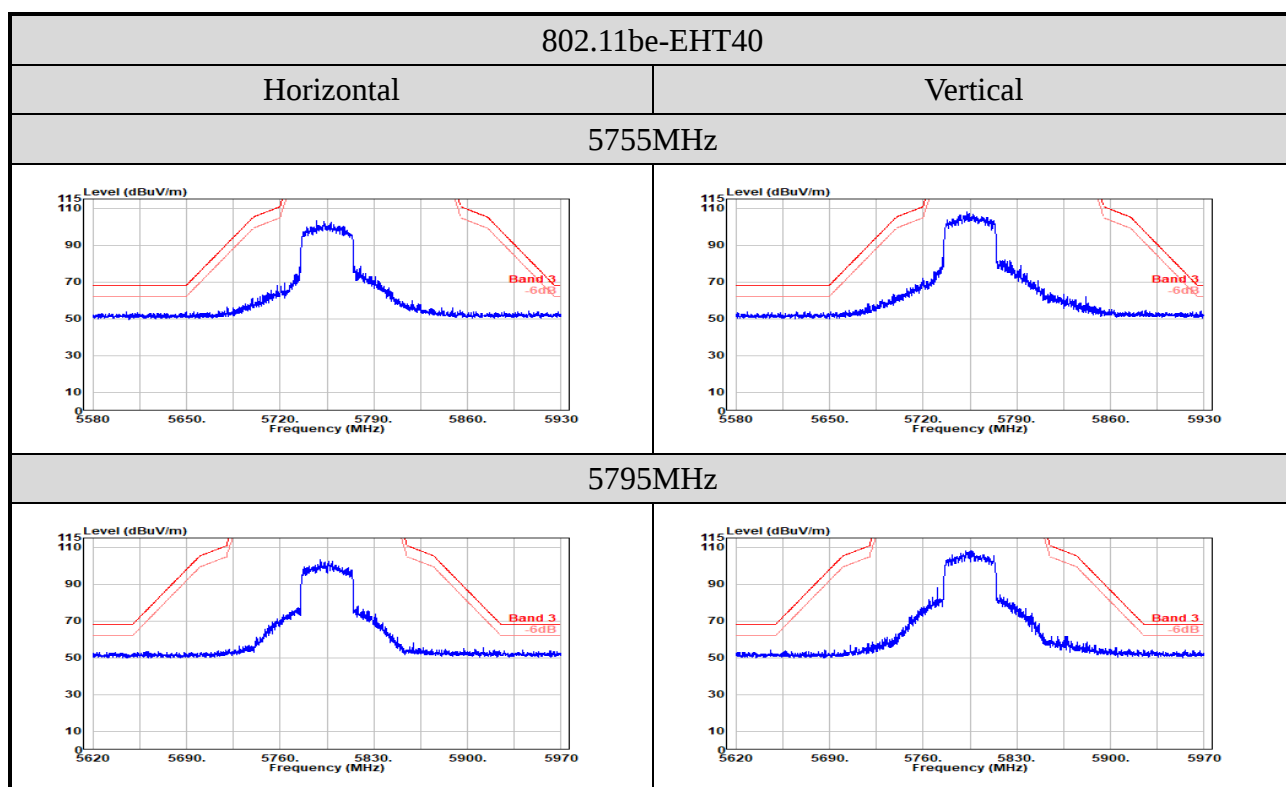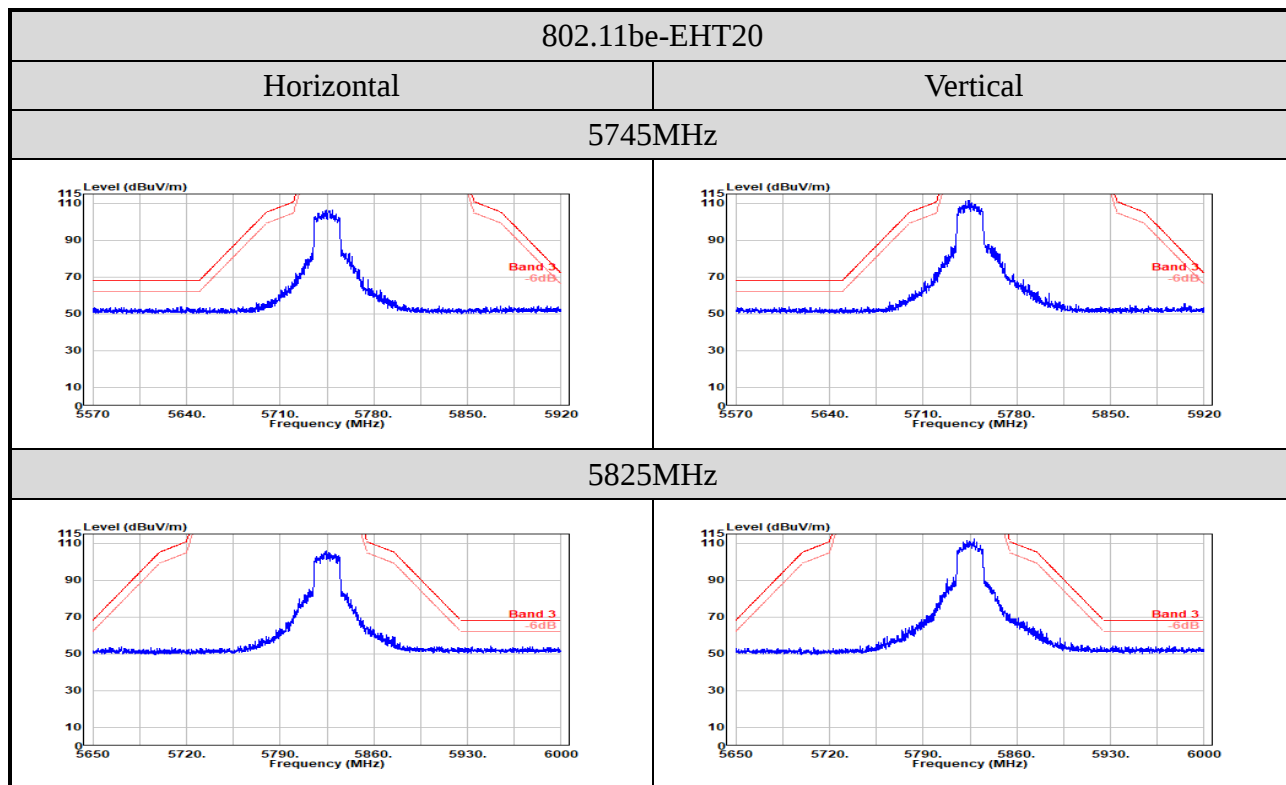


**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel:** +886 2 26099301  
**Fax:** +886 2 26099303

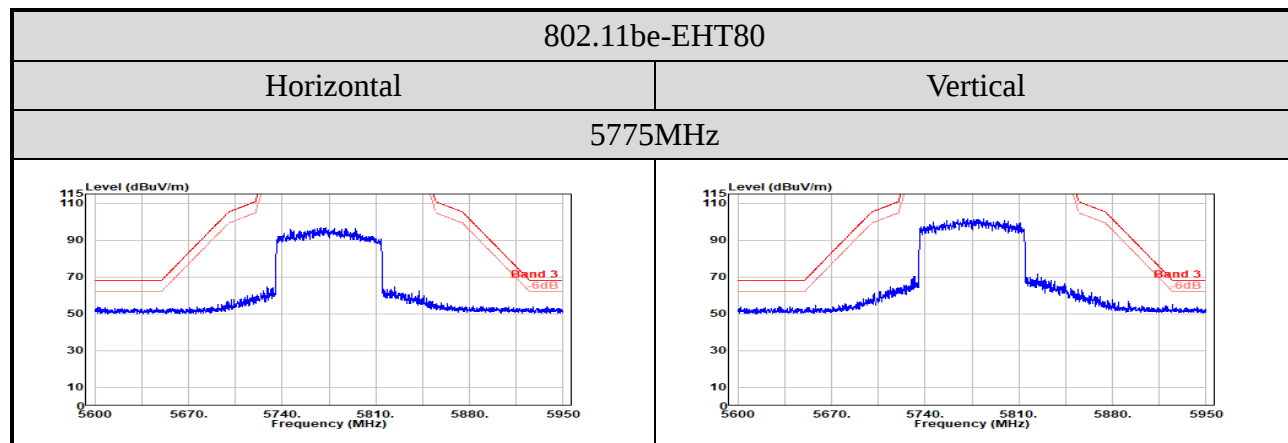


**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

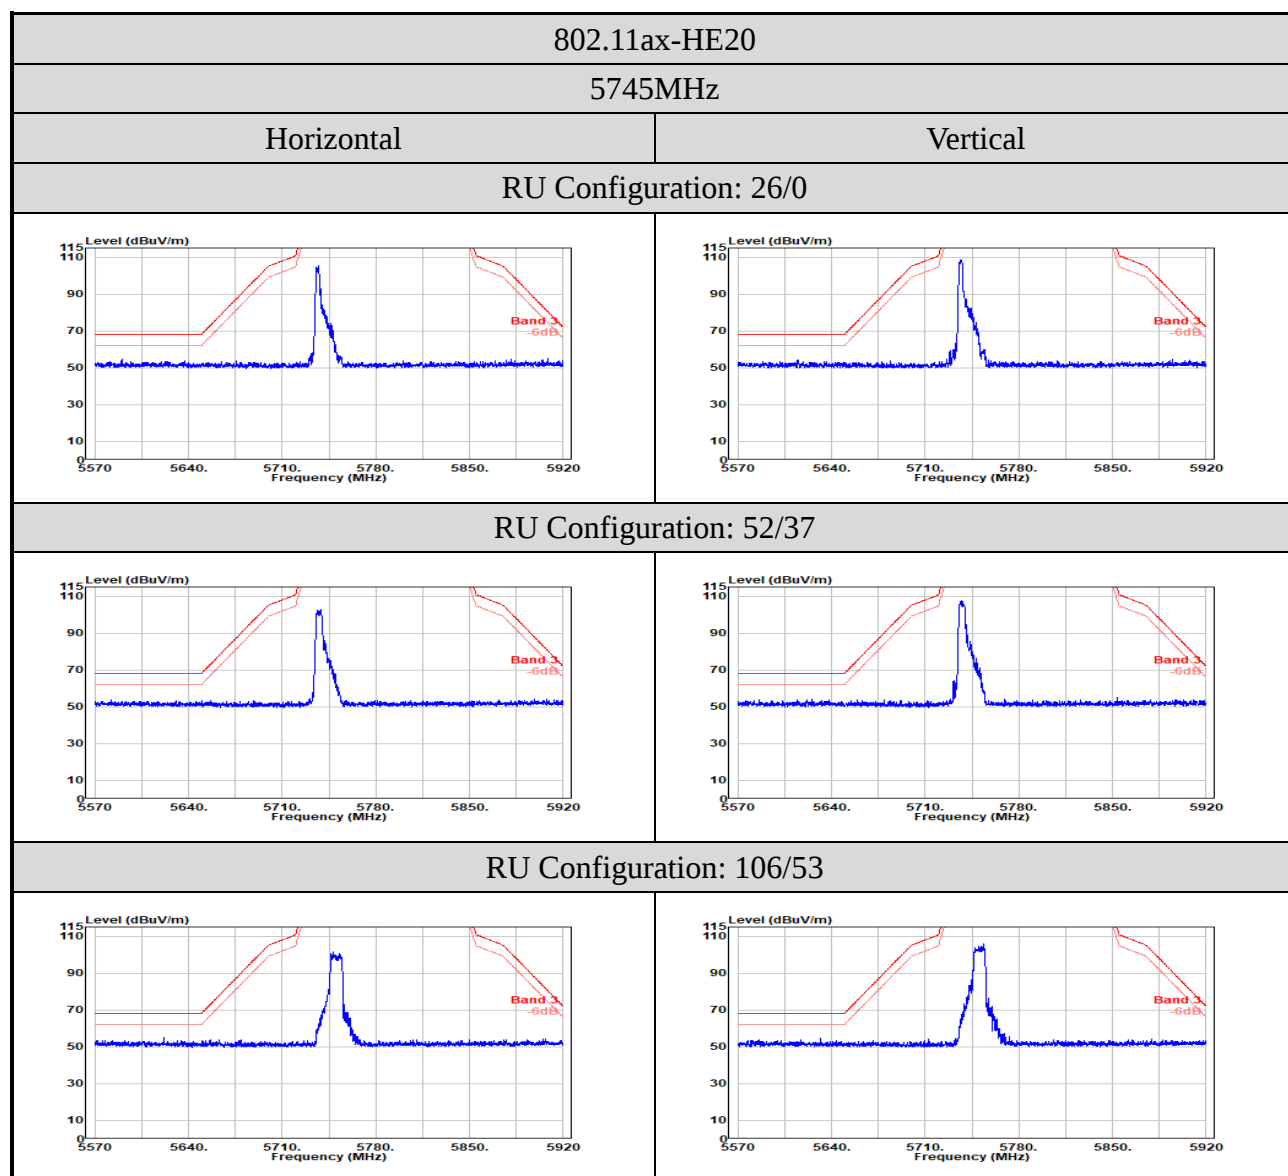


**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan

**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

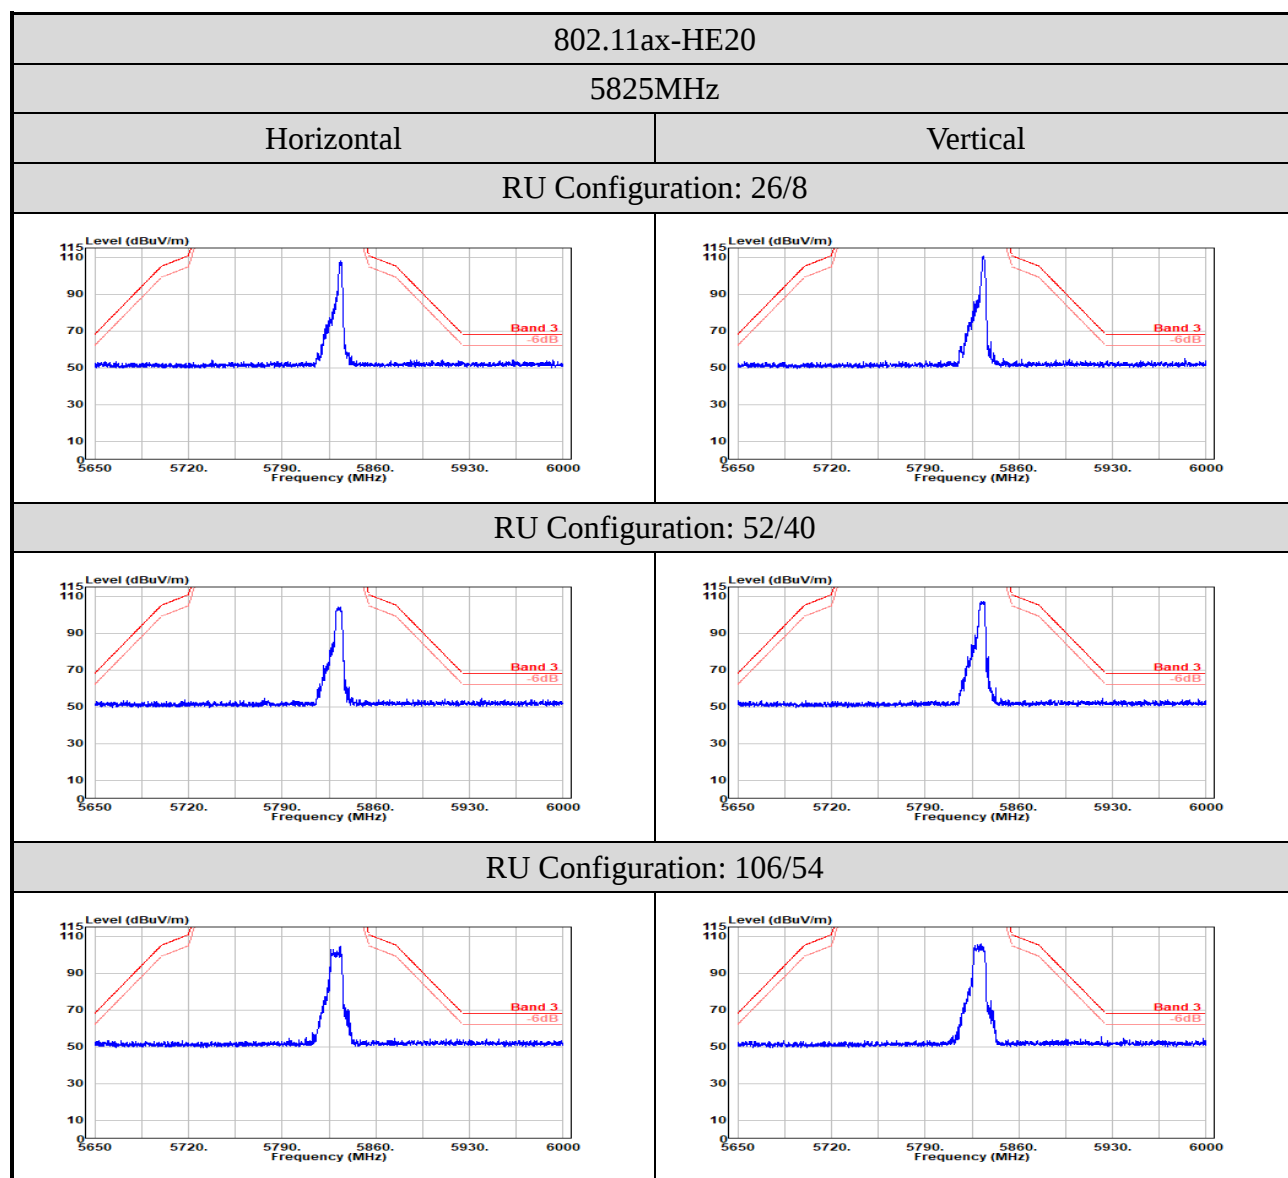


**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan



**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

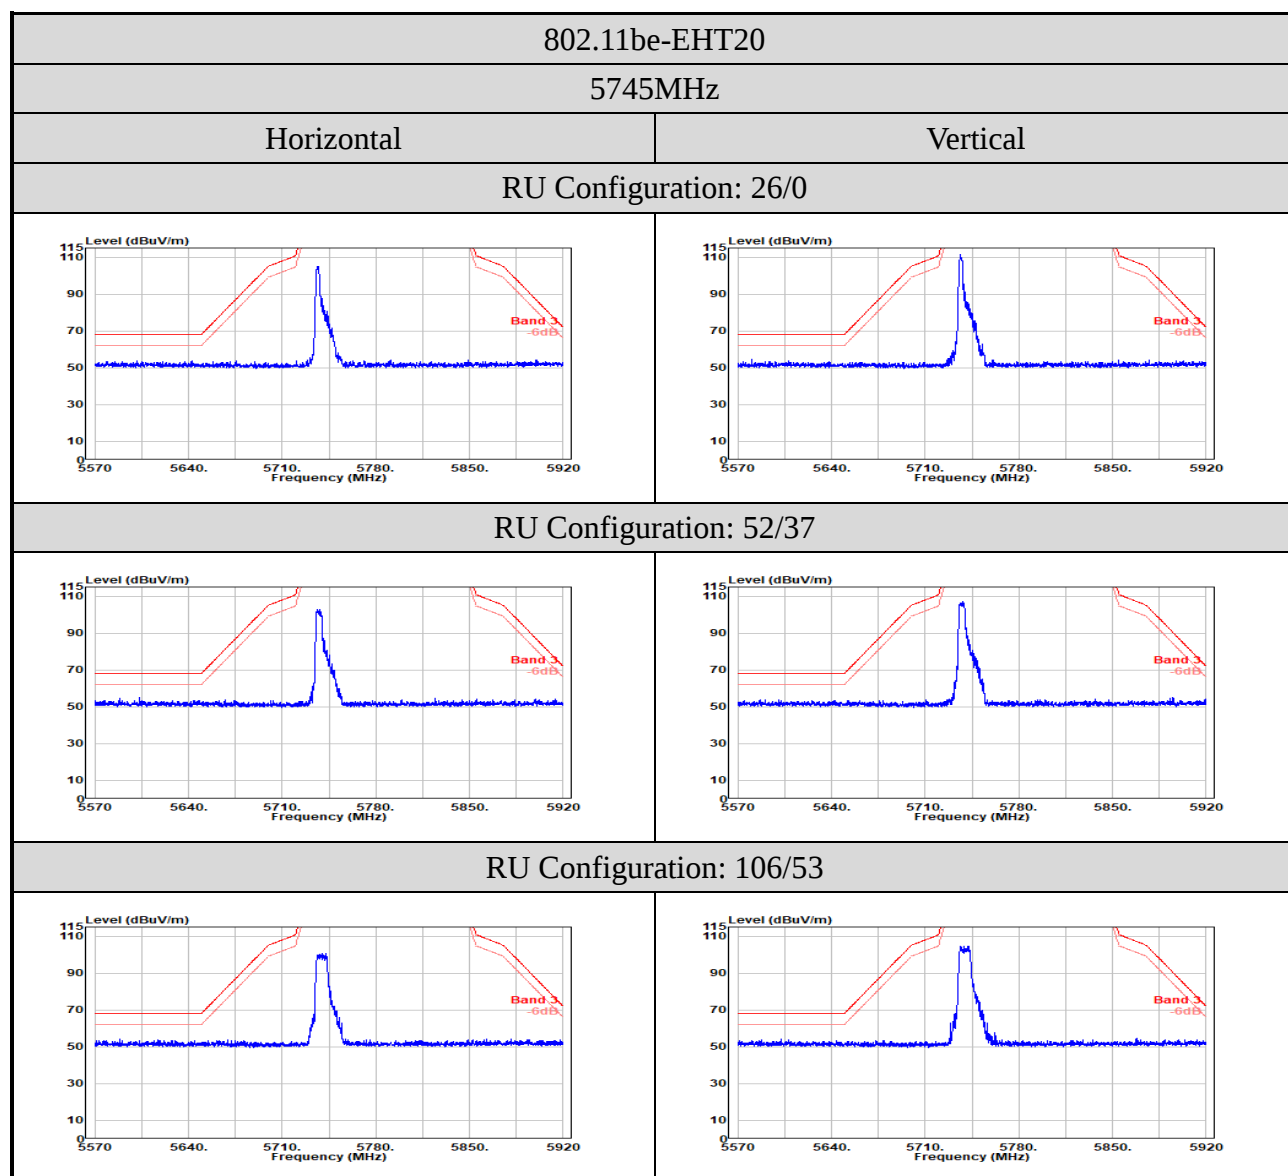

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City244, Taiwan


**Tel: +886 2 26099301**  
**Fax: +886 2 26099303**

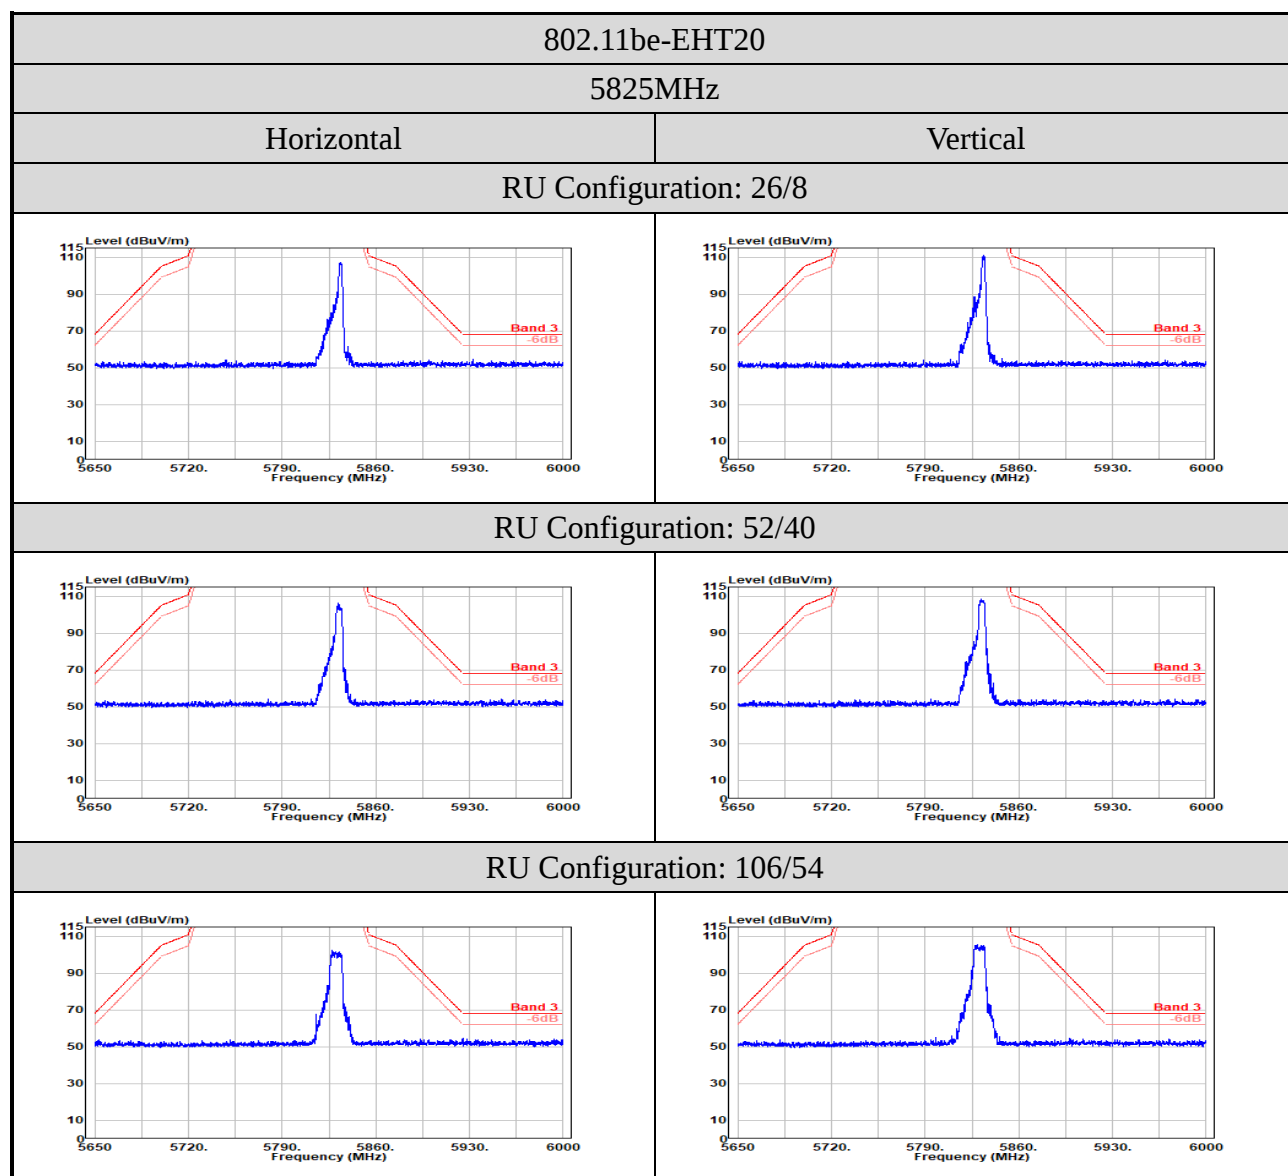

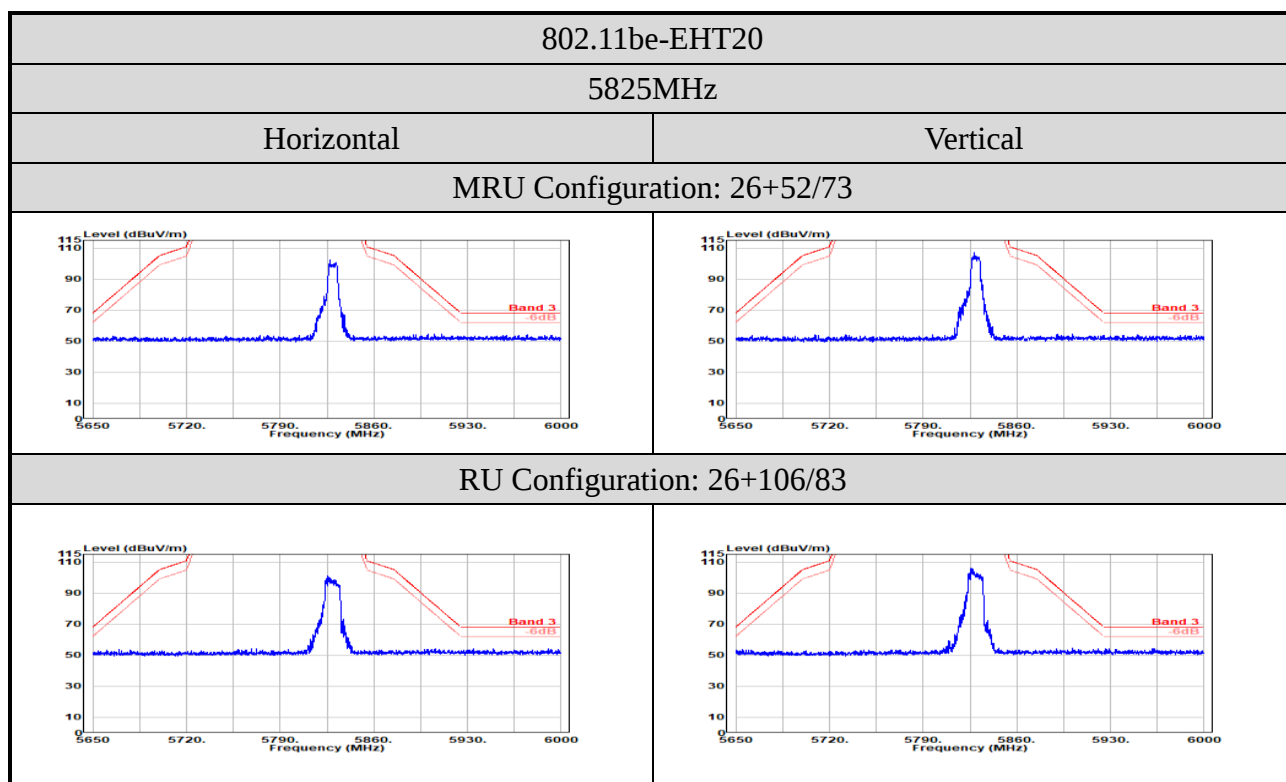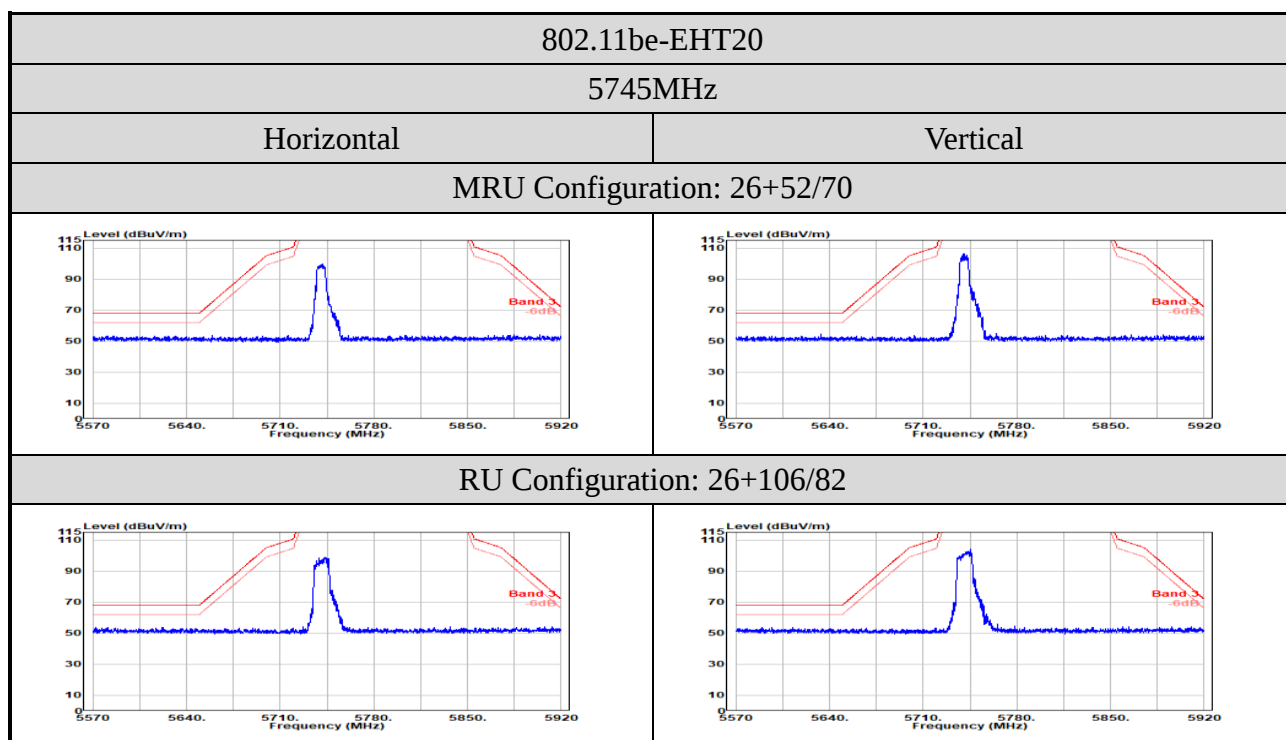

**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City 244, Taiwan

**Tel:** +886 2 26099301  
**Fax:** +886 2 26099303

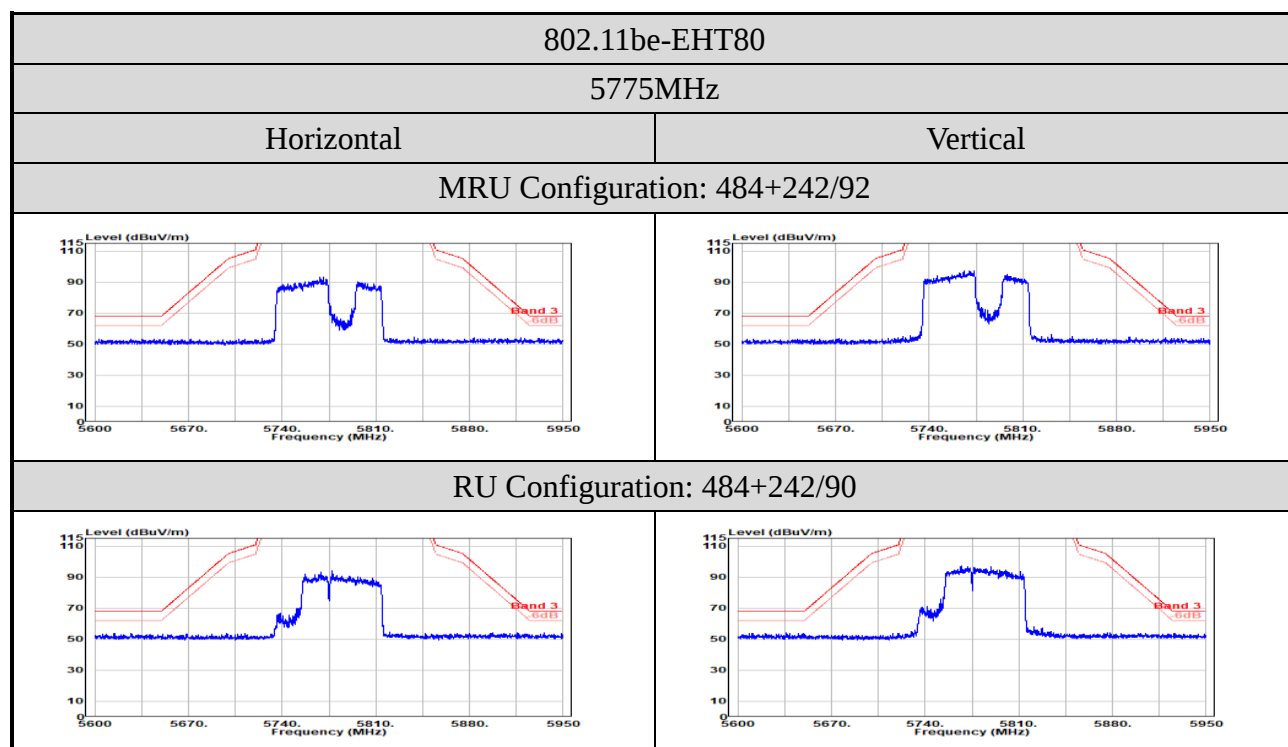



**Audix Technology Corp.**  
No. 491, Zhongfu Rd., Linkou Dist.,  
New Taipei City 244, Taiwan

**Tel:** +886 2 26099301  
**Fax:** +886 2 26099303

---

# APPENDIX B

## TEST PHOTOGRAPHS

(Model: 16Z95U)