



20MHz_Low_QPSK_1@0

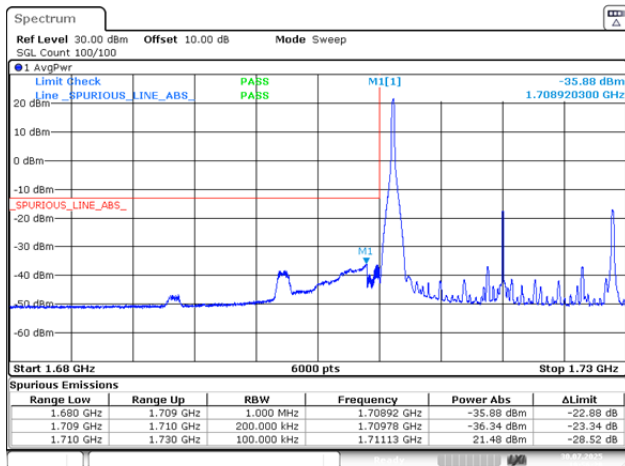


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 30.JUL.2025 19:56:28

20MHz_Low_QPSK_100@0

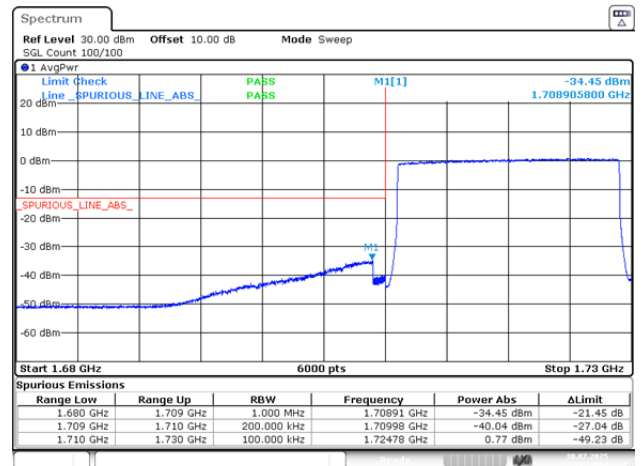


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 30.JUL.2025 19:57:34

20MHz_Low_16QAM_1@0

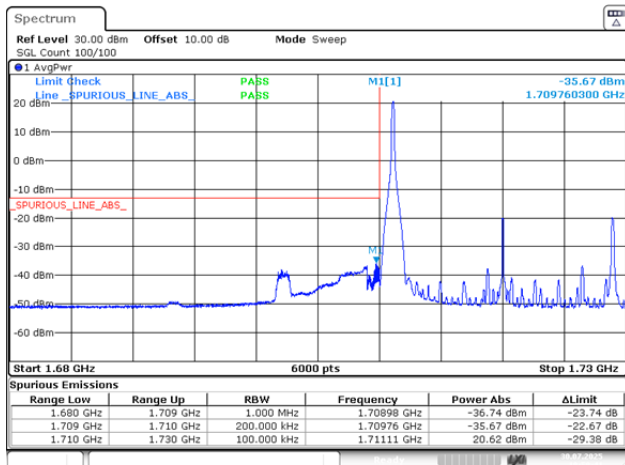


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 30.JUL.2025 19:58:41

20MHz_Low_16QAM_25@0

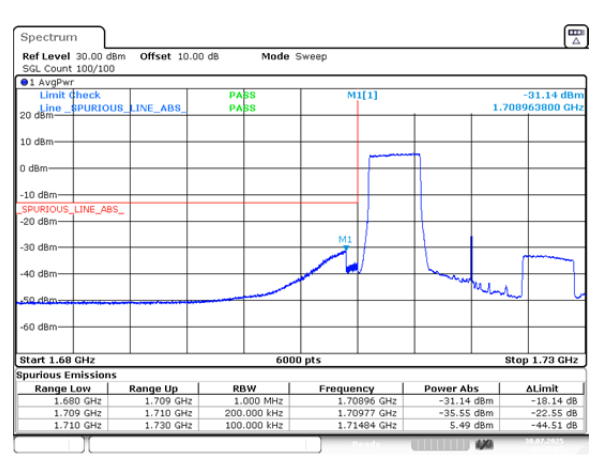


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 30.JUL.2025 16:49:02

20MHz_High_QPSK_1@99

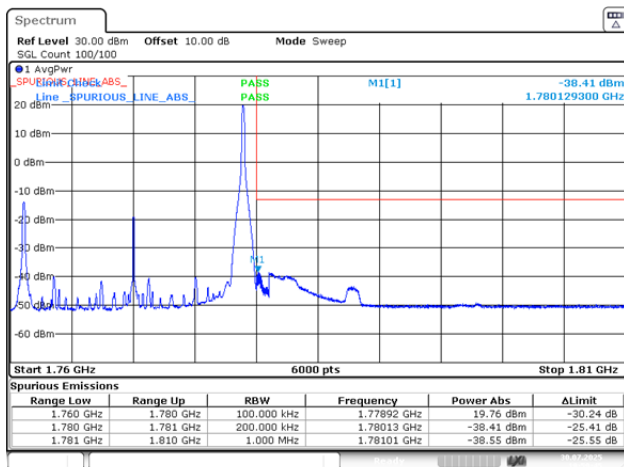


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 30.JUL.2025 19:59:45

20MHz_High_QPSK_100@0

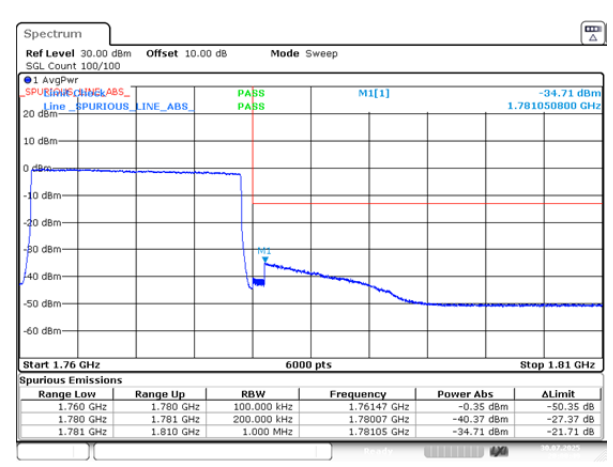


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 30.JUL.2025 20:00:49

20MHz_High_16QAM_1@99

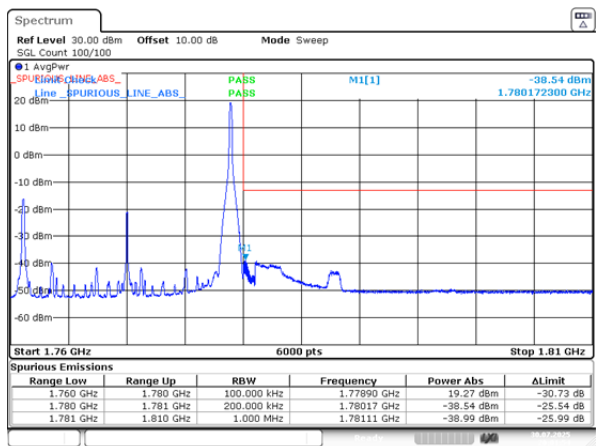

ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 30.JUL.2025 20:01:54

20MHz_High_16QAM_25@75

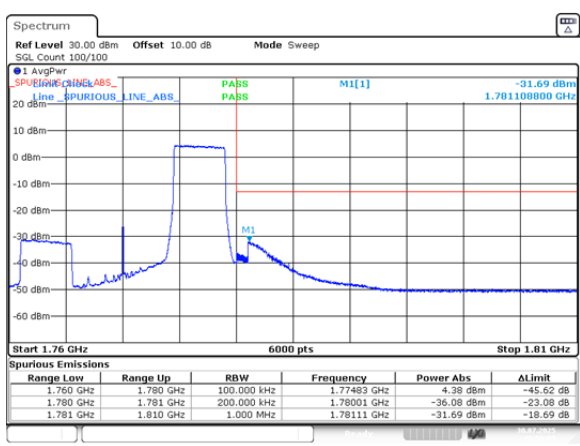

ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 30.JUL.2025 16:50:05


Spurious Emissions at Antenna Terminal**FCC Part 22H****Band 5, Normal**

Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-31.24	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-33.13	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)	-33.28	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-33.18	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-32.74	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~9.49GHz)	-32.03	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-33.08	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-33.29	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~9.49GHz)	-33.00	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-32.63	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-33.01	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~9.49GHz)	-33.00	See Graphs	Pass

Note:1RB was the worst case.


Band 5, Normal
1RB was the worst case

1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)

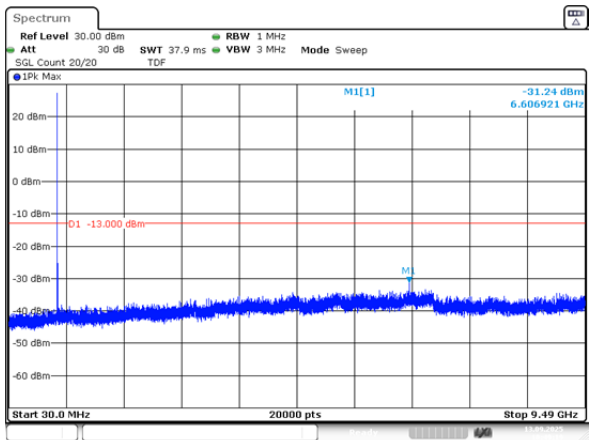


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:49:19

1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

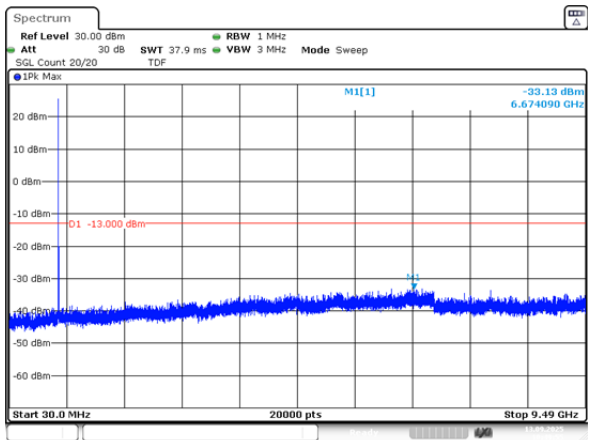


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:49:54

1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)

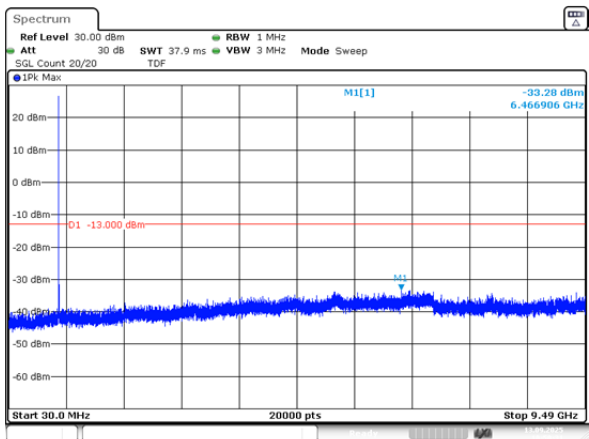


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:50:31

3MHz_Low_QPSK_1@0(30MHz~9.49GHz)

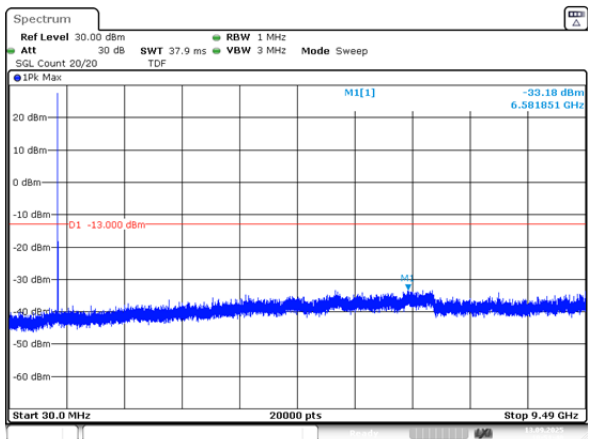


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:51:48

3MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

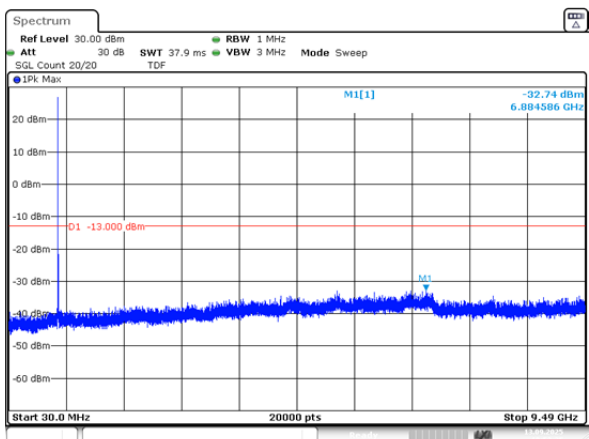


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:52:25

3MHz_High_QPSK_1@0(30MHz~9.49GHz)

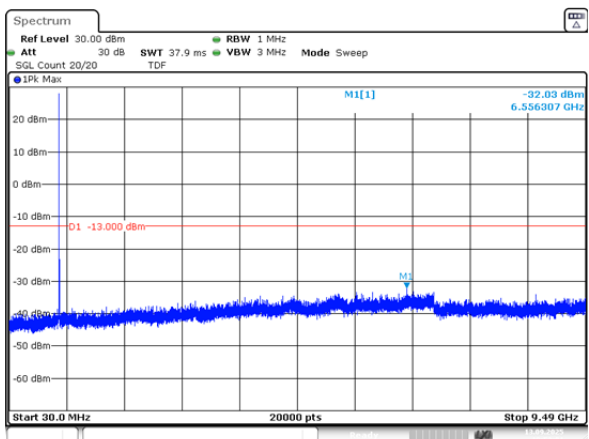


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:53:01

5MHz_Low_QPSK_1@0(30MHz~9.49GHz)

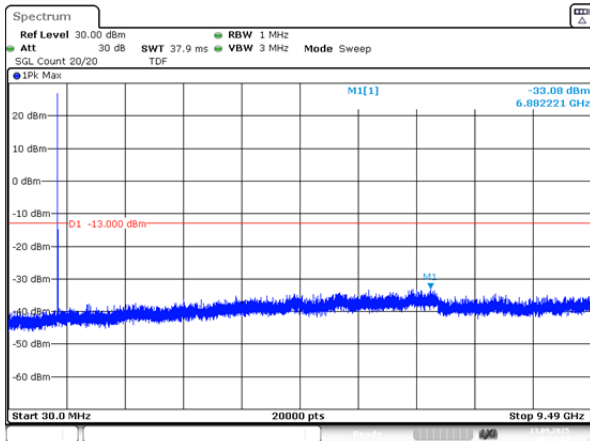


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:54:19

5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

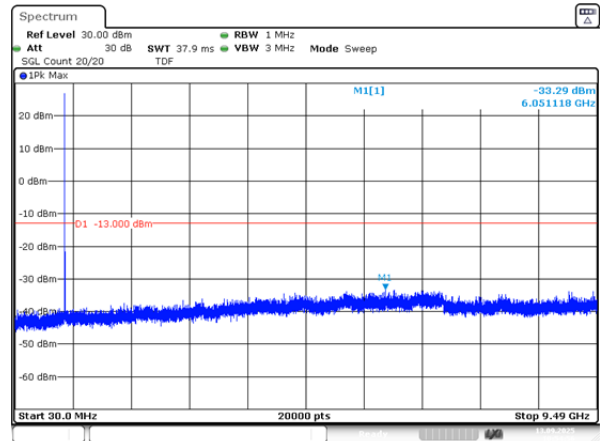


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:54:56

5MHz_High_QPSK_1@0(30MHz~9.49GHz)

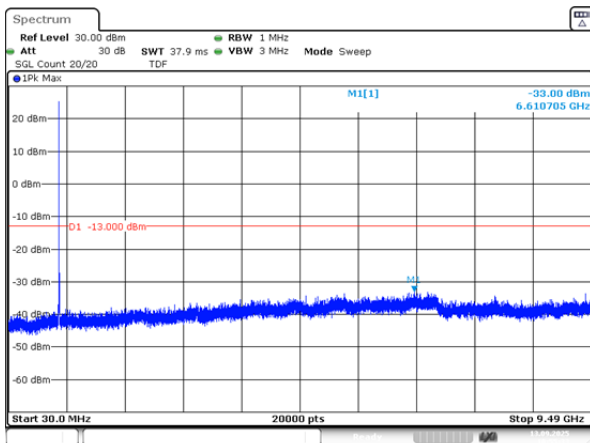


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:55:14

10MHz_Low_QPSK_1@0(30MHz~9.49GHz)

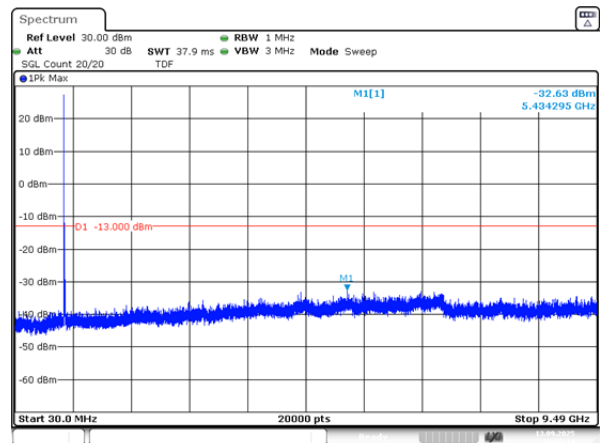


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:56:14

10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

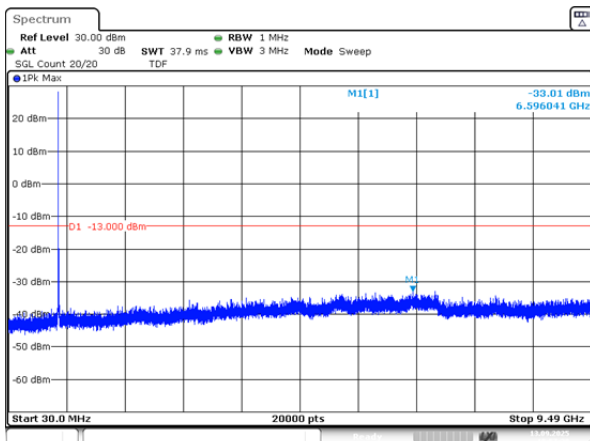

ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:57:29

10MHz_High_QPSK_1@0(30MHz~9.49GHz)

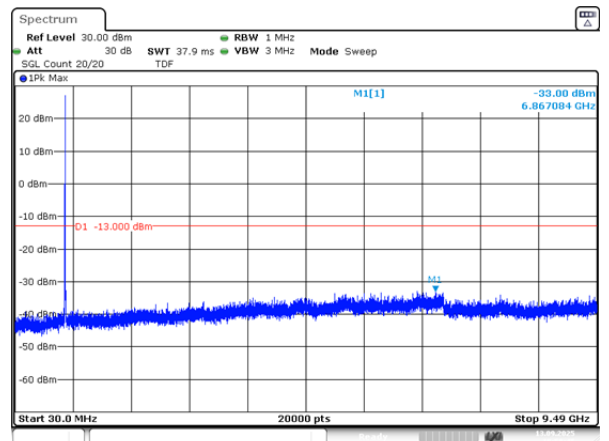

ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:58:45


FCC Part 24E**Band 2, Normal**

Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-31.21	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-30.99	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~20.1GHz)	-30.85	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-31.09	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-31.15	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~20.1GHz)	-31.00	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-30.76	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-31.11	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~20.1GHz)	-30.99	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-30.69	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-29.92	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~20.1GHz)	-31.40	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-30.07	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-30.82	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~20.1GHz)	-31.27	See Graphs	Pass
20MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-30.86	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-30.73	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~20.1GHz)	-30.85	See Graphs	Pass

Note:1RB was the worst case.


Band 2, Normal
1RB was the worst case

1.4MHz_Low_QPSK_1@0(30MHz~20.1GHz)

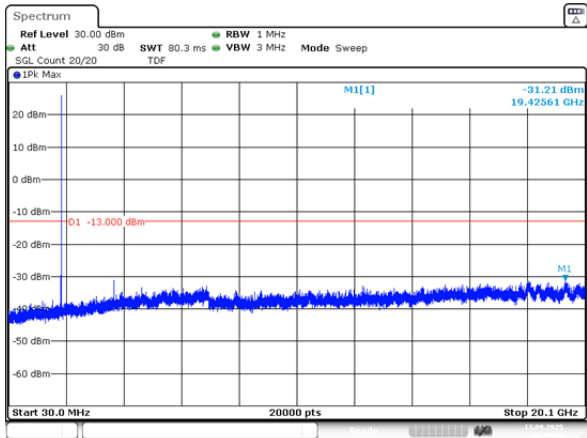


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:09:59

1.4MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

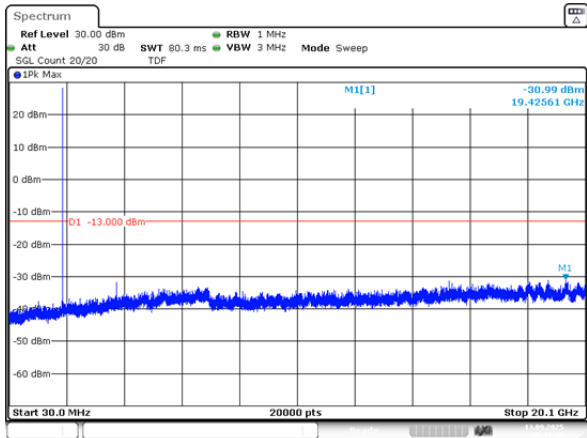


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:10:37

1.4MHz_High_QPSK_1@0(30MHz~20.1GHz)

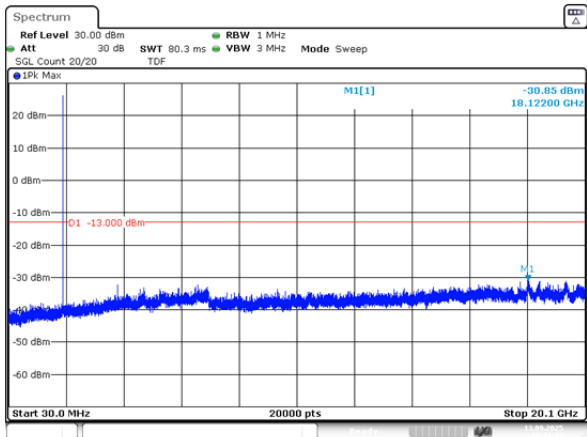


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:11:14

3MHz_Low_QPSK_1@0(30MHz~20.1GHz)

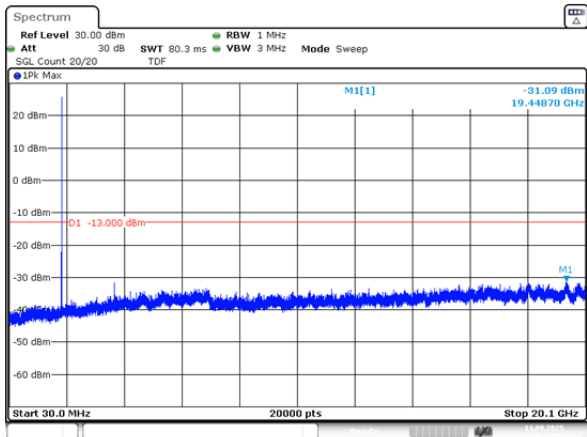


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:11:55

3MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

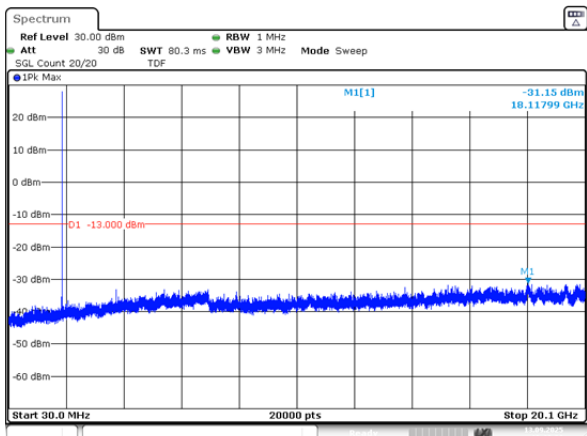


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:12:32

3MHz_High_QPSK_1@0(30MHz~20.1GHz)

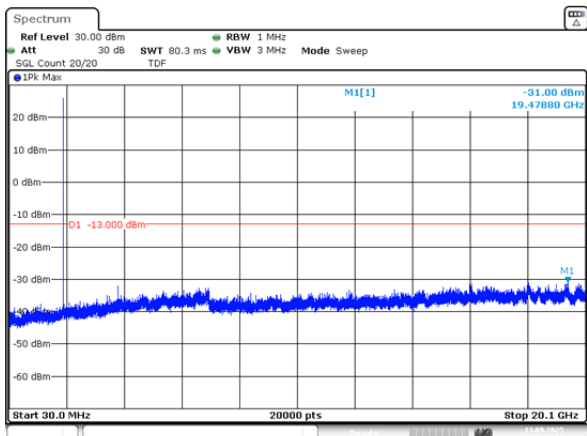


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:13:08

5MHz_Low_QPSK_1@0(30MHz~20.1GHz)

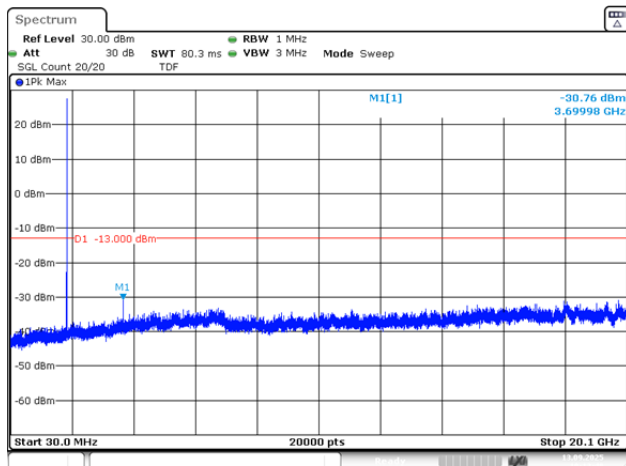


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:13:48

5MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

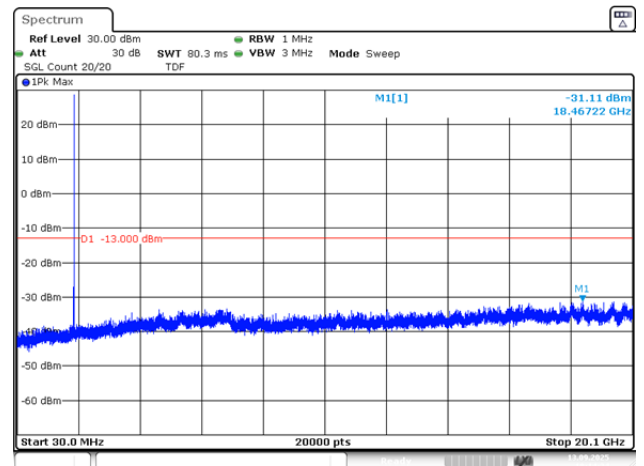


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:14:24

5MHz_High_QPSK_1@0(30MHz~20.1GHz)

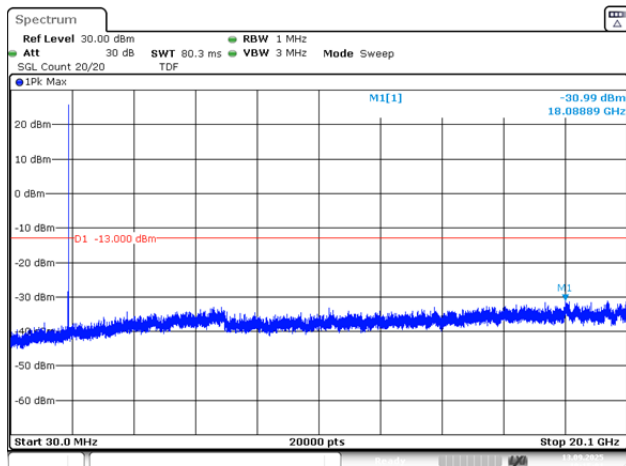


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:15:01

10MHz_Low_QPSK_1@0(30MHz~20.1GHz)

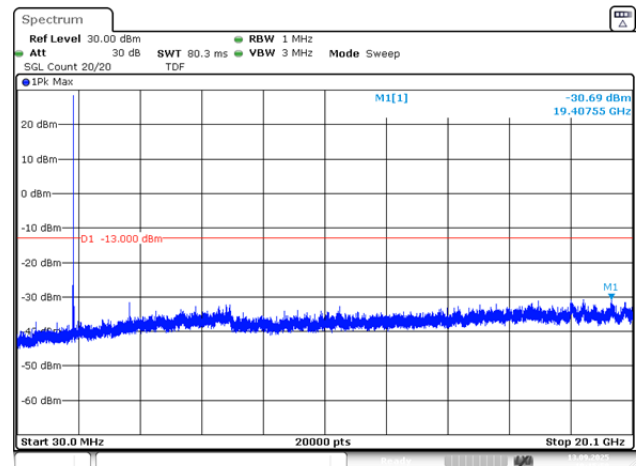


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:15:51

10MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

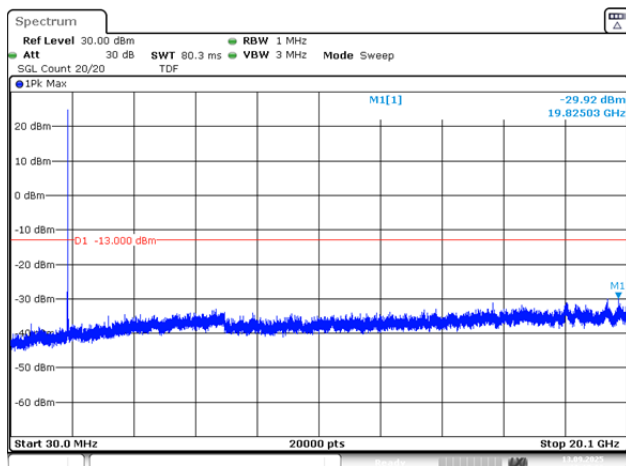


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:17:19

10MHz_High_QPSK_1@0(30MHz~20.1GHz)

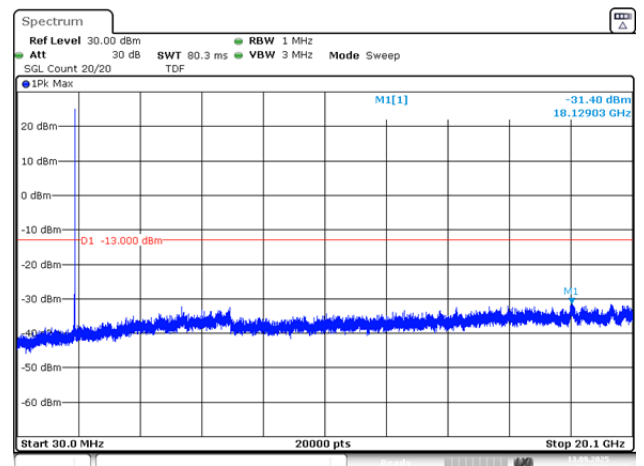


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:18:35

15MHz_Low_QPSK_1@0(30MHz~20.1GHz)

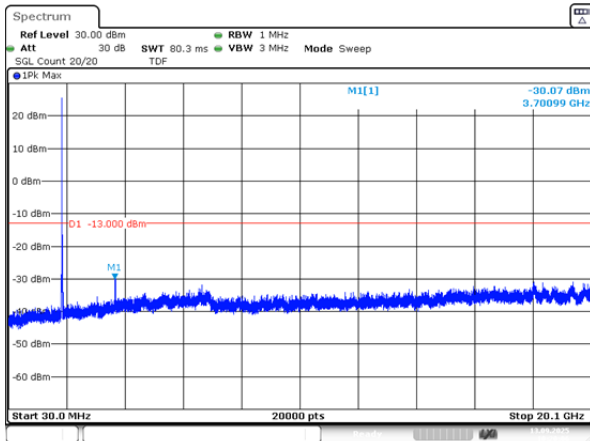


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:20:05

15MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

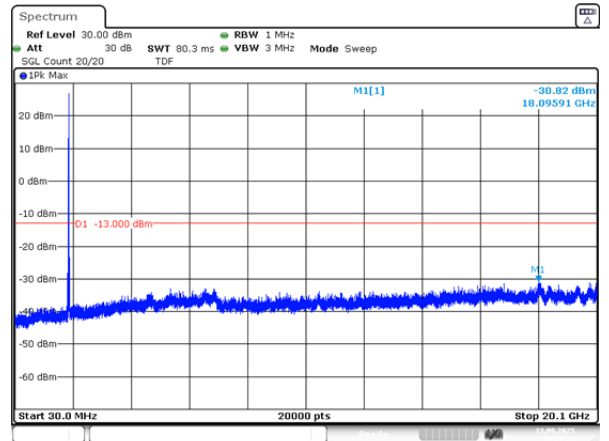


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:21:22

15MHz_High_QPSK_1@0(30MHz~20.1GHz)

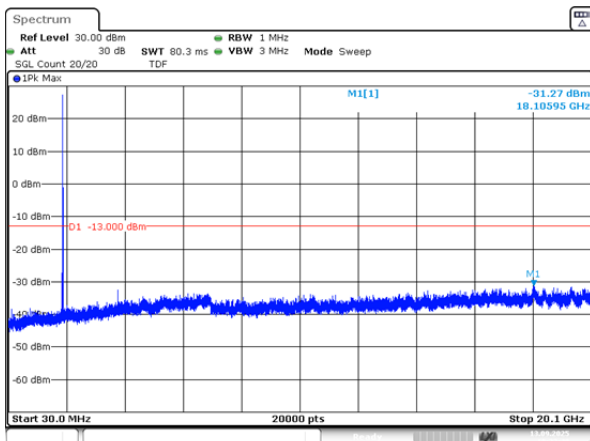


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:22:39

20MHz_Low_QPSK_1@0(30MHz~20.1GHz)

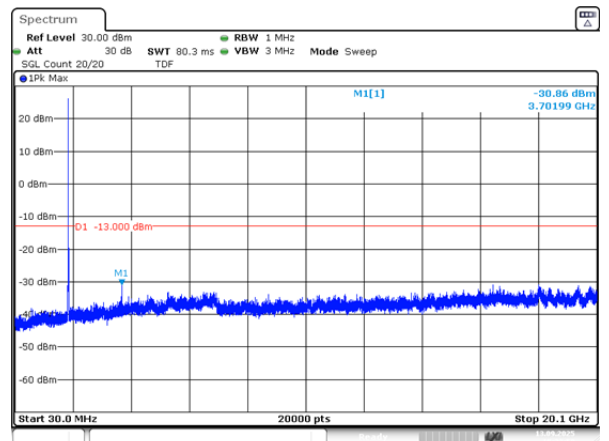


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:23:59

20MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

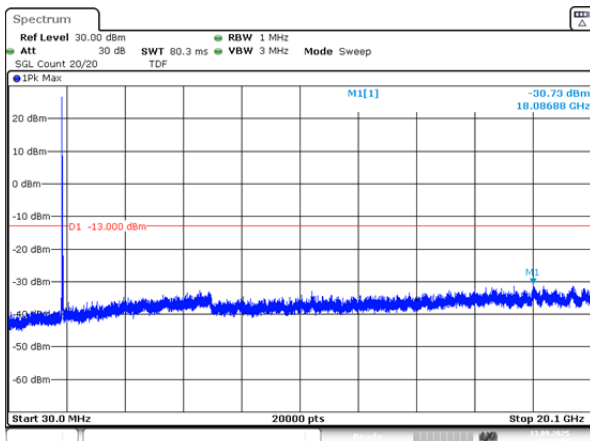

ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:25:17

20MHz_High_QPSK_1@0(30MHz~20.1GHz)

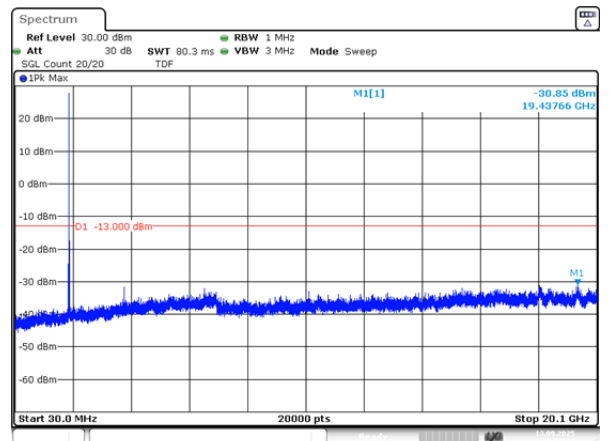

ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:26:37

FCC Part 27

Band 4, Normal

Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-31.42	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-30.81	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~18.55GHz)	-30.96	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-30.88	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-31.12	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~18.55GHz)	-31.84	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-31.51	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-30.98	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~18.55GHz)	-31.23	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-31.22	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-30.51	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~18.55GHz)	-30.42	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-31.19	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-30.81	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~18.55GHz)	-30.45	See Graphs	Pass
20MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-31.19	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-31.06	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~18.55GHz)	-31.33	See Graphs	Pass

Band 7, Normal

Mode	Value (dBm)	Limit	Verdict
5MHz_Low_QPSK_1@0(30MHz~26.7GHz)	-34.18	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~26.7GHz)	-35.60	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~26.7GHz)	-32.91	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~26.7GHz)	-35.25	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~26.7GHz)	-35.65	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~26.7GHz)	-34.22	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~26.7GHz)	-36.09	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~26.7GHz)	-35.39	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~26.7GHz)	-36.11	See Graphs	Pass

Mode	Value (dBm)	Limit	Verdict
20MHz_Low_QPSK_1@0(30MHz~26.7GHz)	-35.87	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~26.7GHz)	-35.71	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~26.7GHz)	-33.85	See Graphs	Pass


Band 66, Normal

Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-31.06	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-31.44	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~18.8GHz)	-30.70	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-31.45	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-31.25	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~18.8GHz)	-31.08	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-30.98	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-31.46	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~18.8GHz)	-29.72	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-31.49	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-31.07	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~18.8GHz)	-30.41	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-31.24	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-30.50	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~18.8GHz)	-31.56	See Graphs	Pass
20MHz_Low_QPSK_1@0(30MHz~18.8GHz)	-31.57	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~18.8GHz)	-29.80	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~18.8GHz)	-30.24	See Graphs	Pass

Note:1RB was the worst case.


Band 4, Normal
1RB was the worst case

1.4MHz_Low_QPSK_1@0(30MHz~18.55GHz)

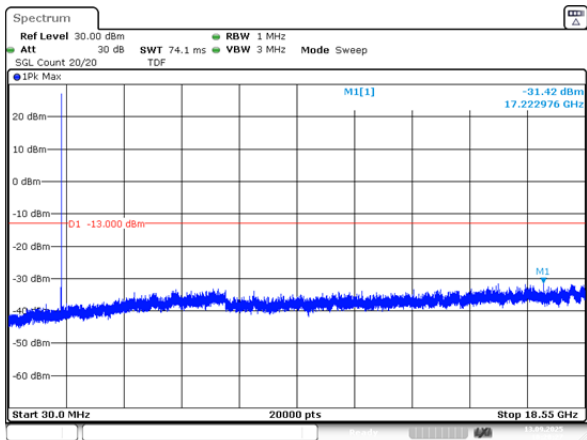


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:28:27

1.4MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

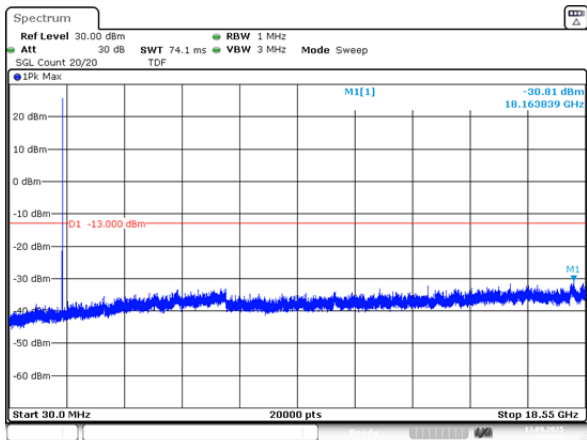


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:29:07

1.4MHz_High_QPSK_1@0(30MHz~18.55GHz)

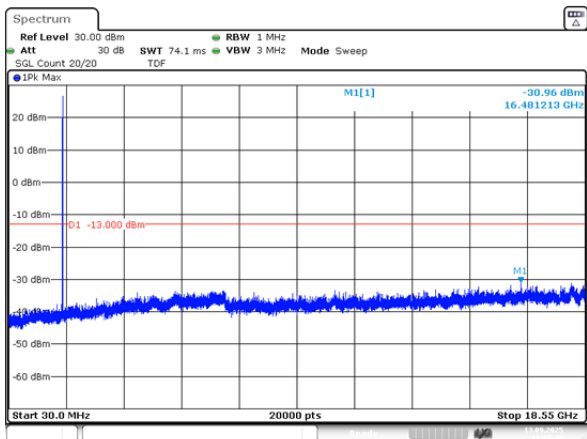


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:29:46

3MHz_Low_QPSK_1@0(30MHz~18.55GHz)

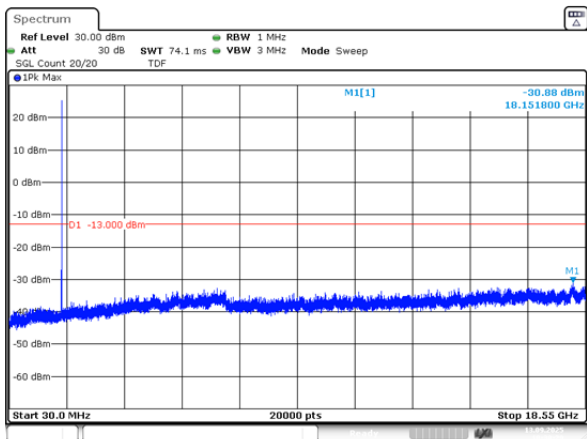


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:30:29

3MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

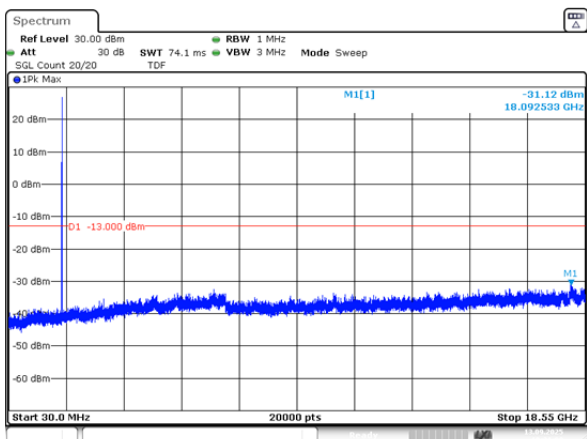


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:31:09

3MHz_High_QPSK_1@0(30MHz~18.55GHz)

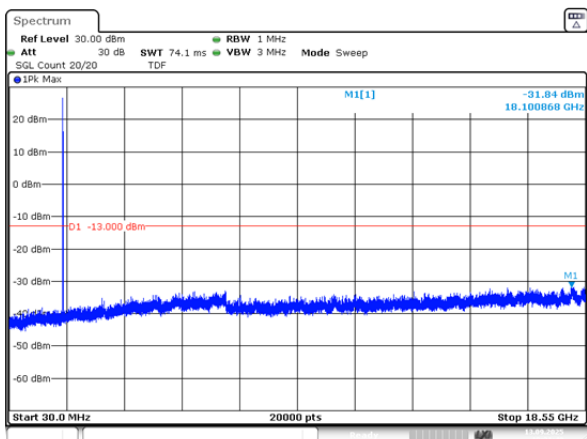


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 10:31:49

5MHz_Low_QPSK_1@0(30MHz~18.55GHz)

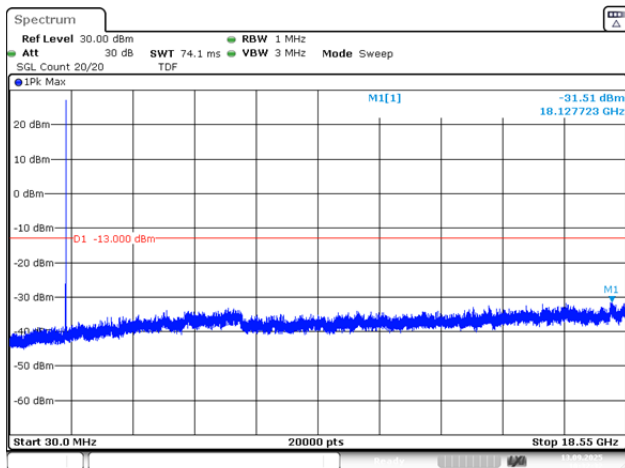


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:32:32

5MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

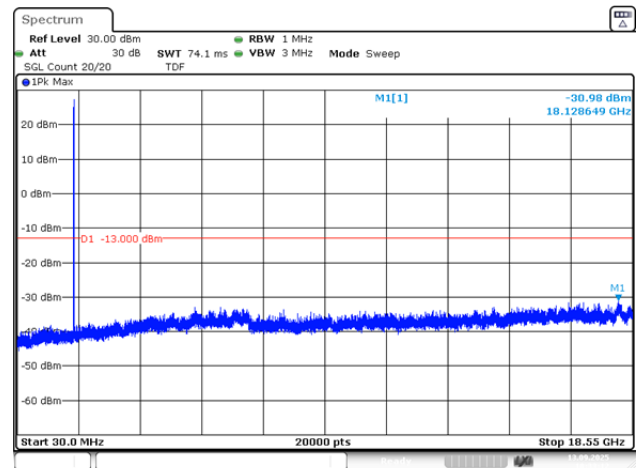


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:33:13

5MHz_High_QPSK_1@0(30MHz~18.55GHz)

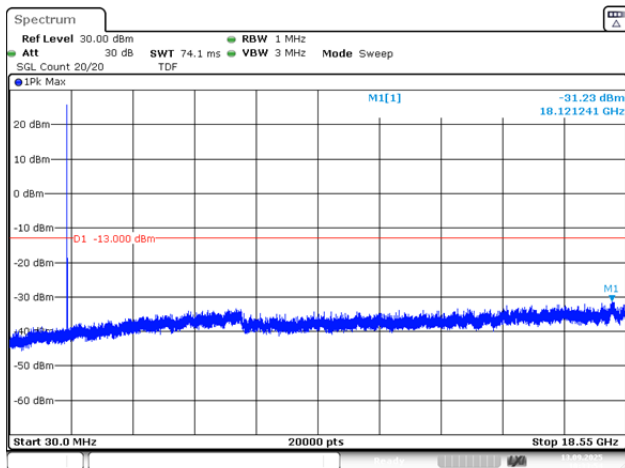


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:33:53

10MHz_Low_QPSK_1@0(30MHz~18.55GHz)

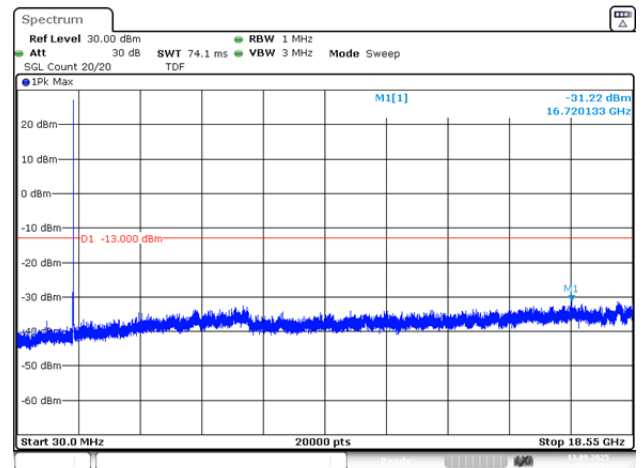


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:35:19

10MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

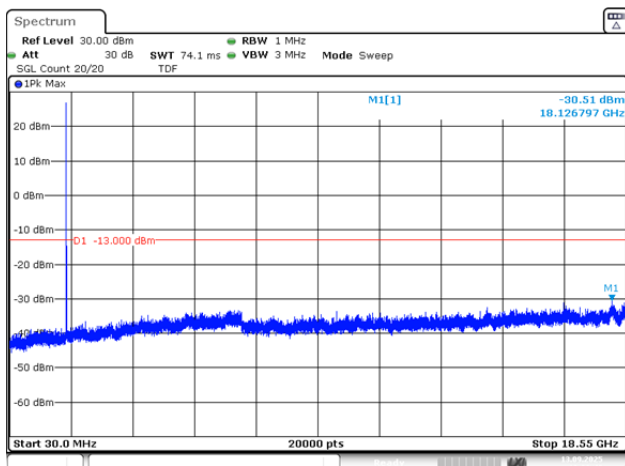


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:36:40

10MHz_High_QPSK_1@0(30MHz~18.55GHz)

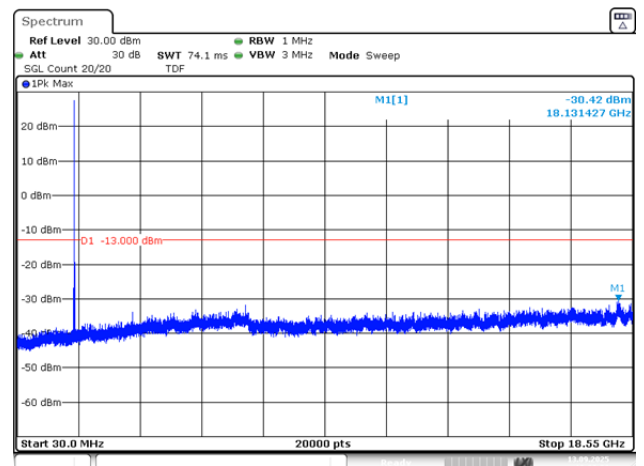


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:38:02

15MHz_Low_QPSK_1@0(30MHz~18.55GHz)

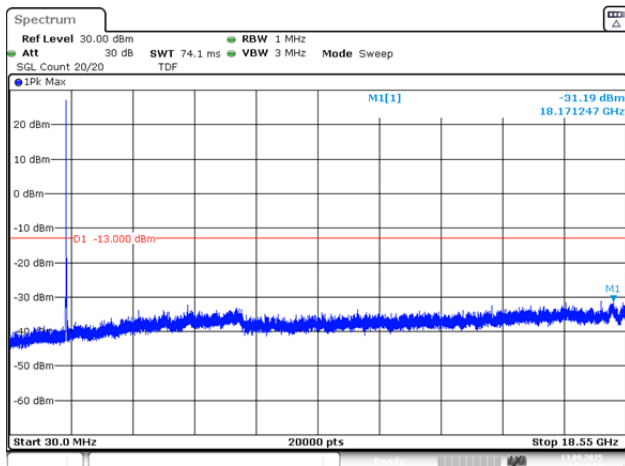


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:40:09

15MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

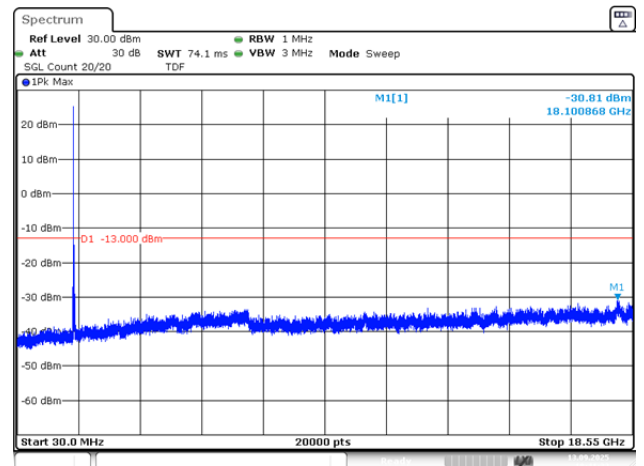


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:41:31

15MHz_High_QPSK_1@0(30MHz~18.55GHz)

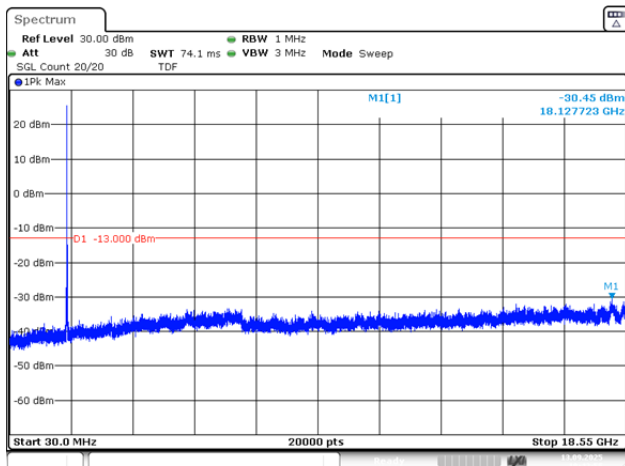


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:42:54

20MHz_Low_QPSK_1@0(30MHz~18.55GHz)

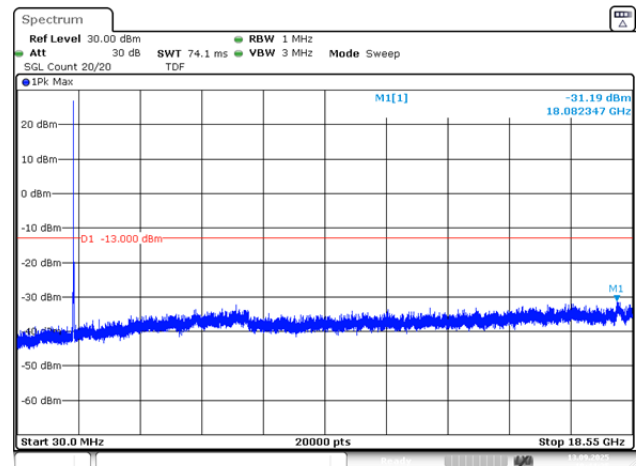


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:44:25

20MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

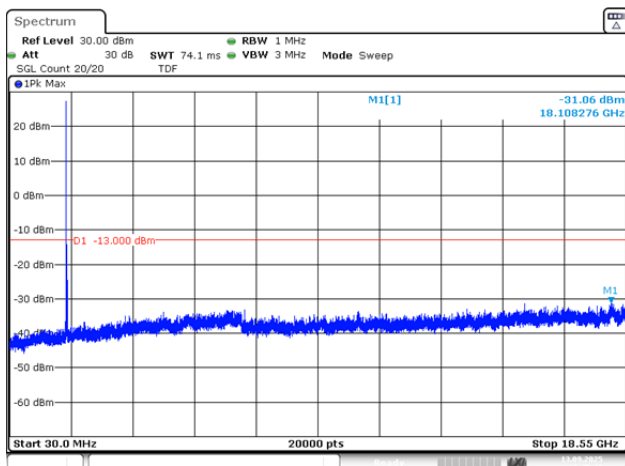

ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:45:49


20MHz_High_QPSK_1@0(30MHz~18.55GHz)

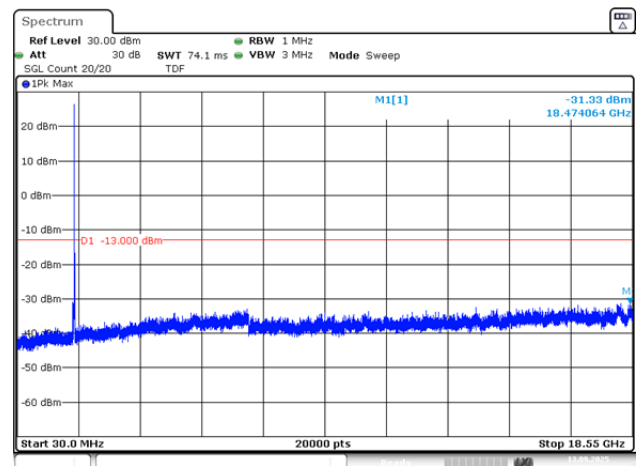


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 10:47:20

Band 7, Normal
1RB was the worst case


5MHz_Low_QPSK_1@0(30MHz~26.7GHz)

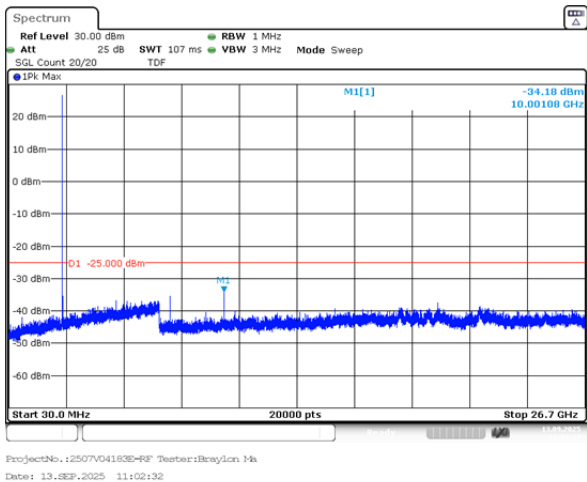


5MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

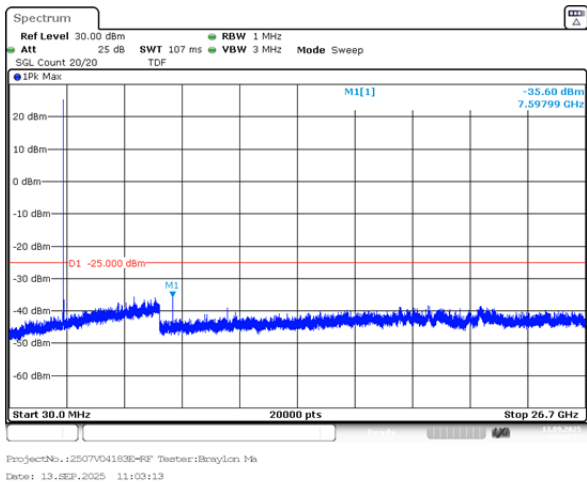


5MHz_High_QPSK_1@0(30MHz~26.7GHz)

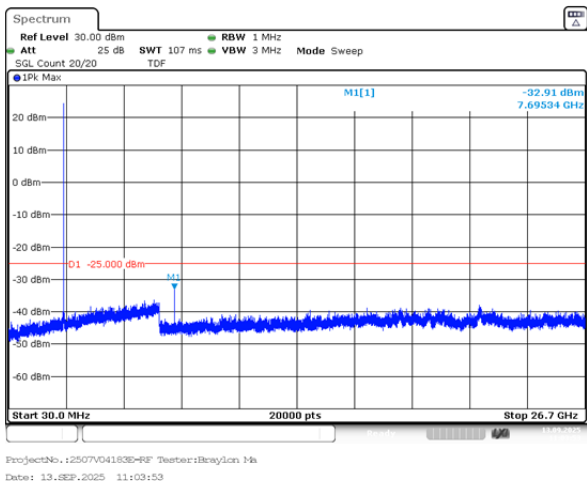


10MHz_Low_QPSK_1@0(30MHz~26.7GHz)

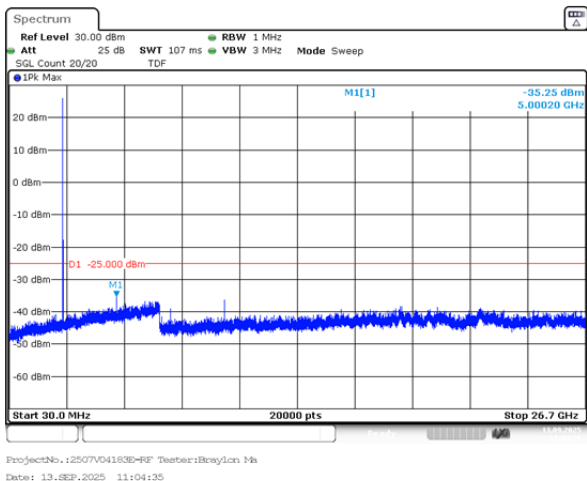


10MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

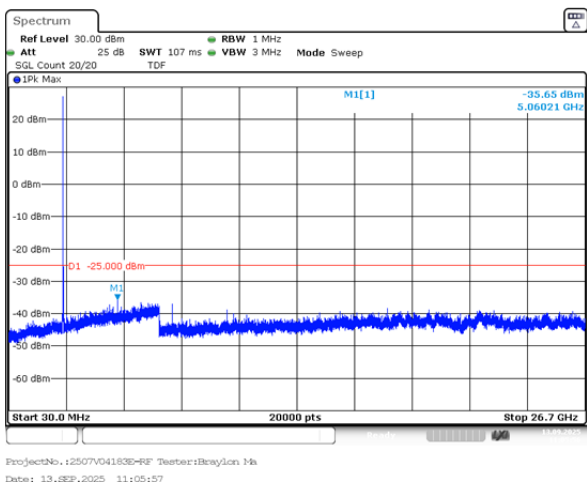

10MHz_High_QPSK_1@0(30MHz~26.7GHz)

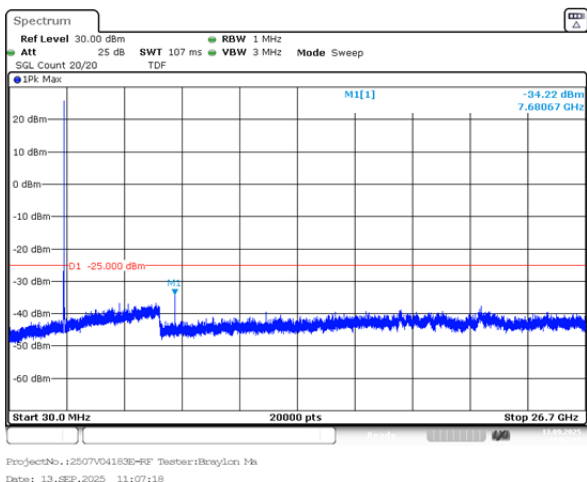


15MHz_Low_QPSK_1@0(30MHz~26.7GHz)

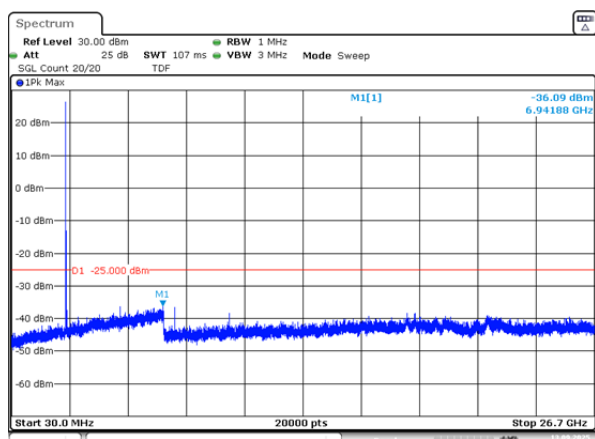


ProjectNo.:2507V04183E-RF Testers:Raydon Ma
Date: 13.SEP.2025 11:08:50

15MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

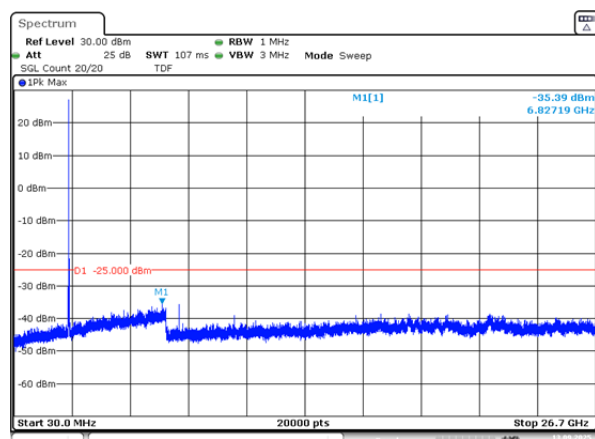


ProjectNo.:2507V04183E-RF Testers:Raydon Ma
Date: 13.SEP.2025 11:10:13

15MHz_High_QPSK_1@0(30MHz~26.7GHz)

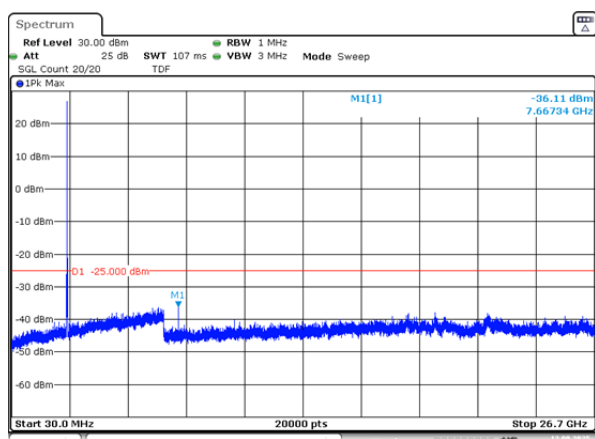


ProjectNo.:2507V04183E-RF Testers:Raydon Ma
Date: 13.SEP.2025 11:11:35

20MHz_Low_QPSK_1@0(30MHz~26.7GHz)

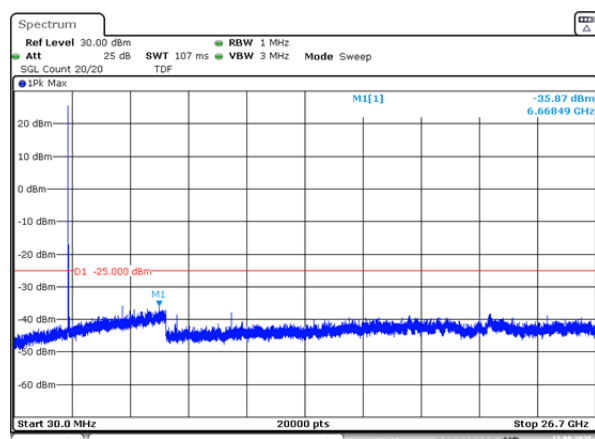


ProjectNo.:2507V04183E-RF Testers:Raydon Ma
Date: 13.SEP.2025 11:13:02

20MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

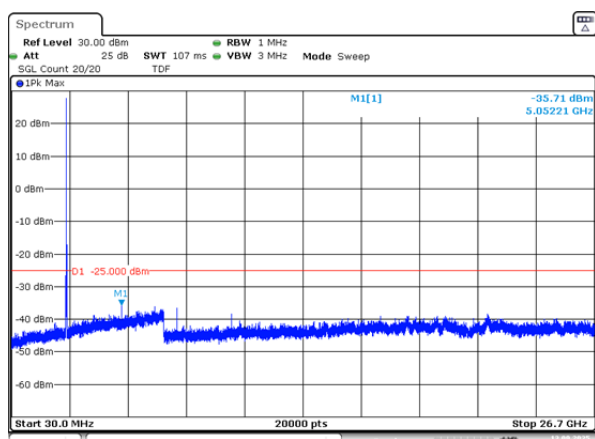

ProjectNo.:2507V04183E-RF Testers:Raydon Ma
Date: 13.SEP.2025 11:14:25


20MHz_High_QPSK_1@0(30MHz~26.7GHz)

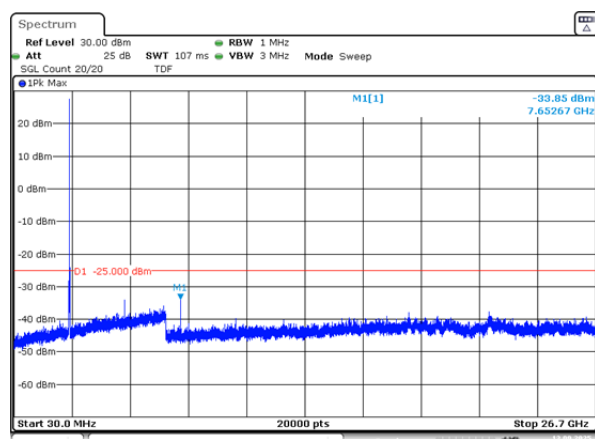

ProjectNo.:2507V04183E-RF Testers:Raydon Ma
Date: 13.SEP.2025 11:15:53


Band 66, Normal
1RB was the worst case

1.4MHz_Low_QPSK_1@0(30MHz~18.8GHz)

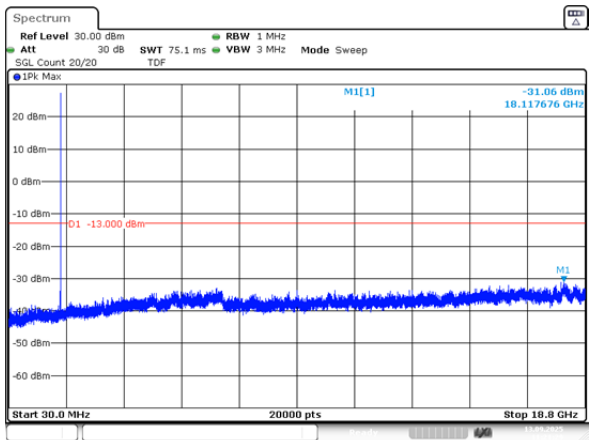


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 11:21:29

1.4MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

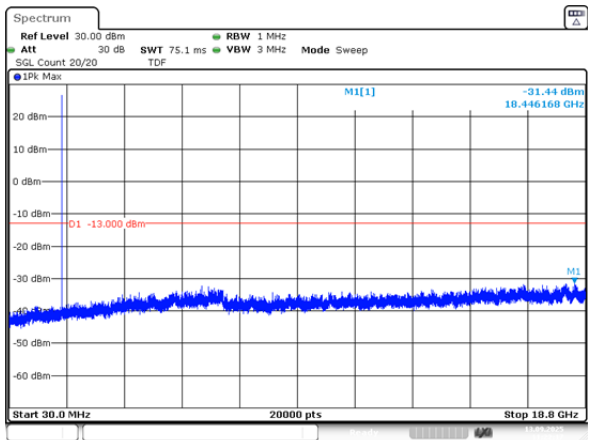


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 11:22:17

1.4MHz_High_QPSK_1@0(30MHz~18.8GHz)

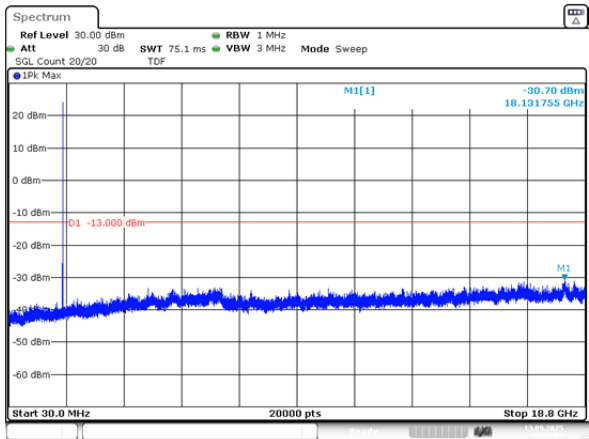


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 11:23:04

3MHz_Low_QPSK_1@0(30MHz~18.8GHz)

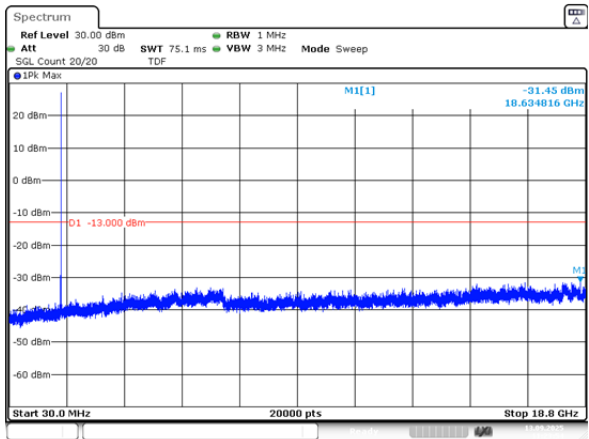


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 11:23:53

3MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

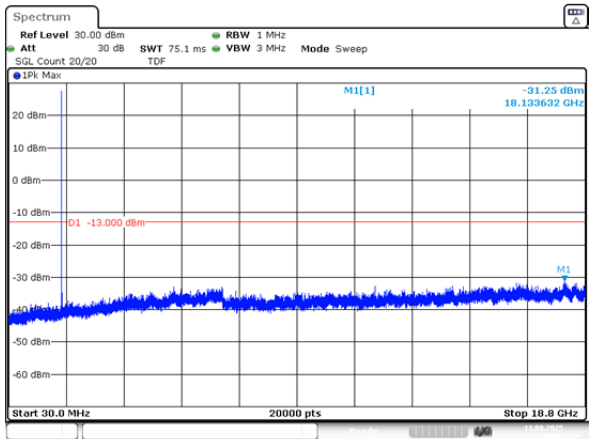


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 11:24:42

3MHz_High_QPSK_1@0(30MHz~18.8GHz)

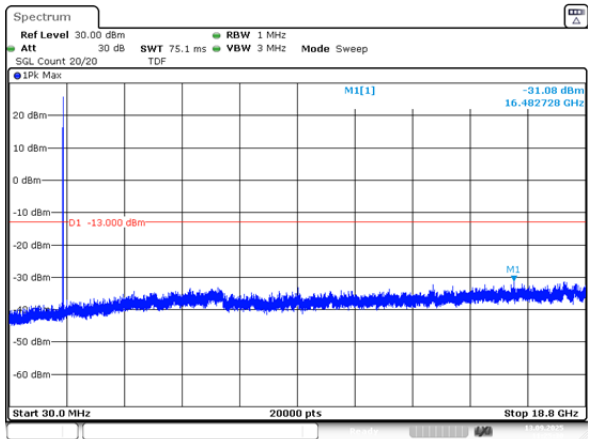


ProjectNo.:2507V04183E-RF Testers:Braylon Ma
Date: 13.SEP.2025 11:25:30

5MHz_Low_QPSK_1@0(30MHz~18.8GHz)

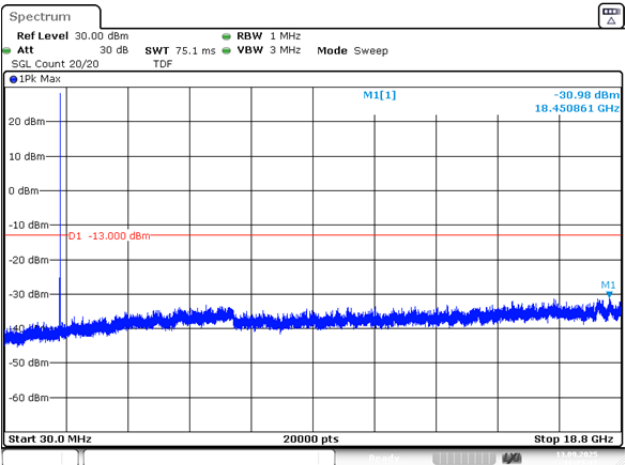


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 11:27:12

5MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

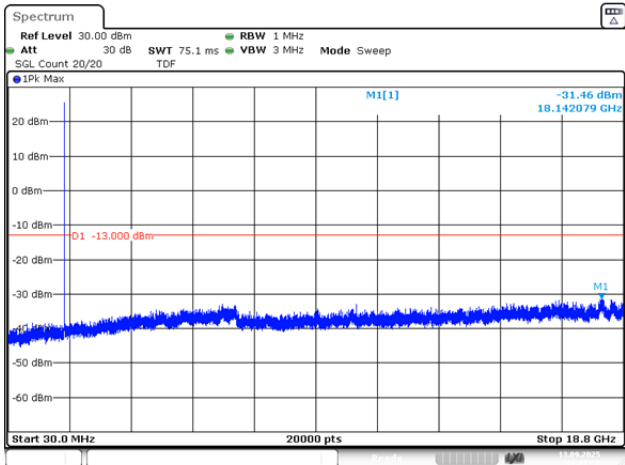


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 11:27:58

5MHz_High_QPSK_1@0(30MHz~18.8GHz)

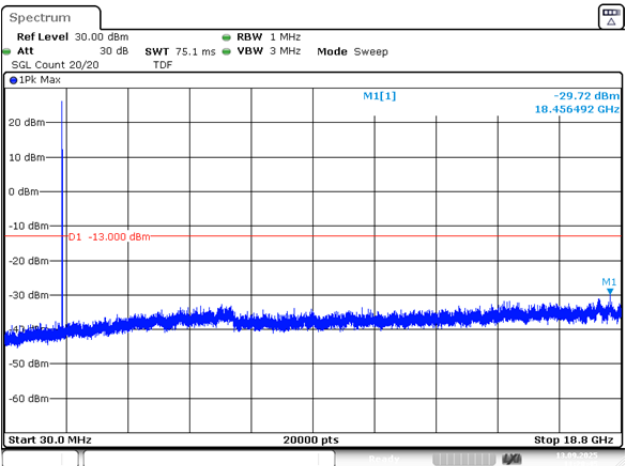


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 11:28:45

10MHz_Low_QPSK_1@0(30MHz~18.8GHz)

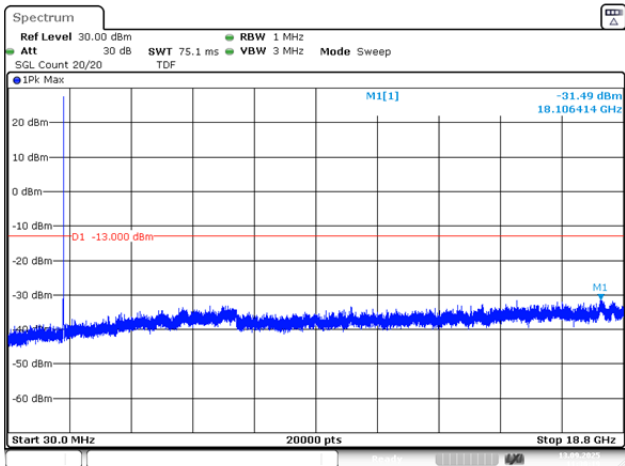


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 11:30:19

10MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

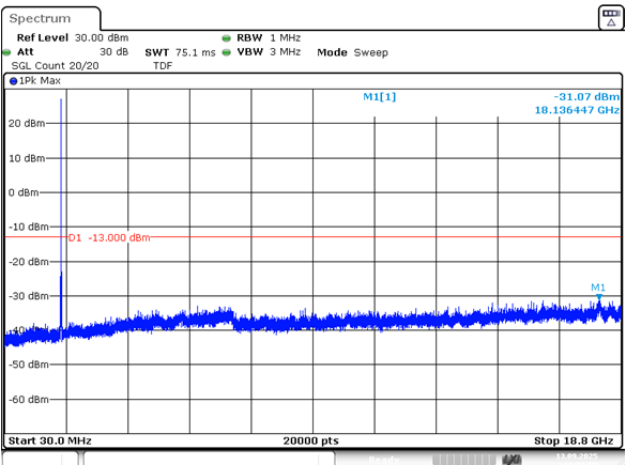


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 11:31:53

10MHz_High_QPSK_1@0(30MHz~18.8GHz)

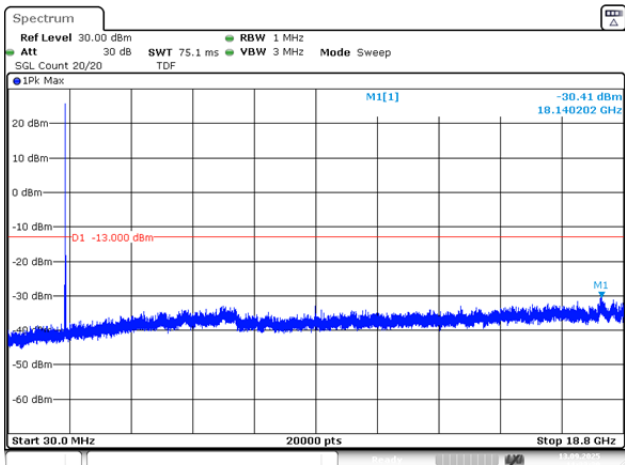


ProjectNo.:2507V04183E-RF Tester:Braylon Ma
Date: 13.SEP.2025 11:33:31


15MHz_Low_QPSK_1@0(30MHz~18.8GHz)

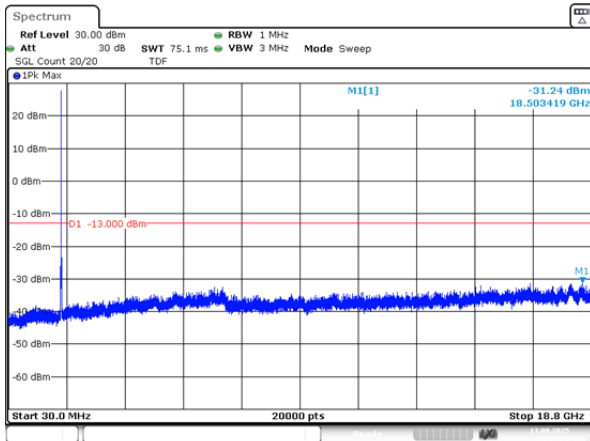


15MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

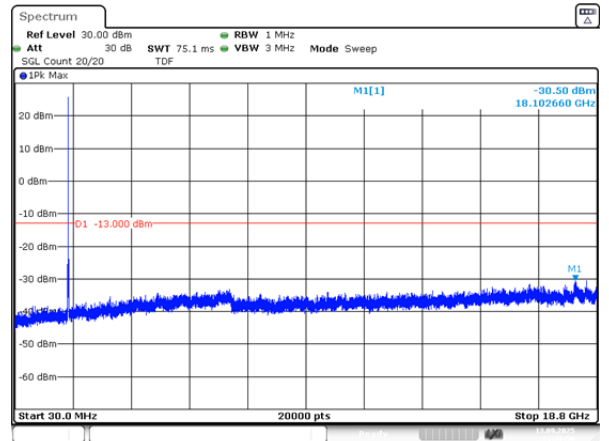


15MHz_High_QPSK_1@0(30MHz~18.8GHz)

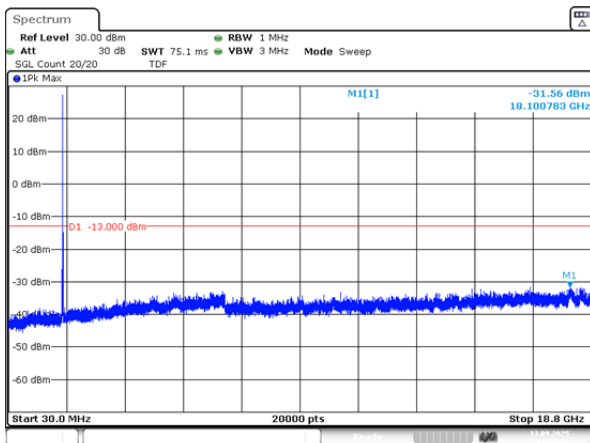

20MHz_Low_QPSK_1@0(30MHz~18.8GHz)

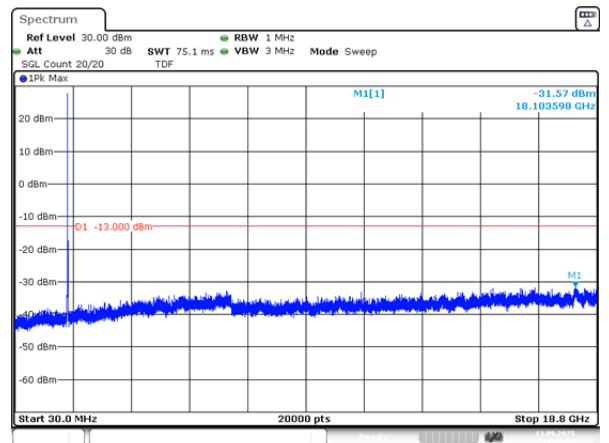

20MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

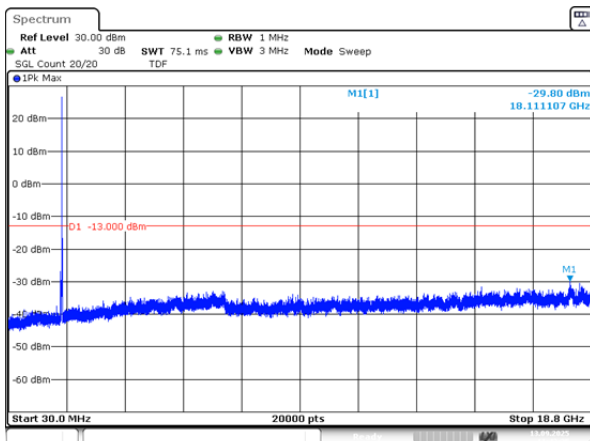

20MHz_High_QPSK_1@0(30MHz~18.8GHz)

