



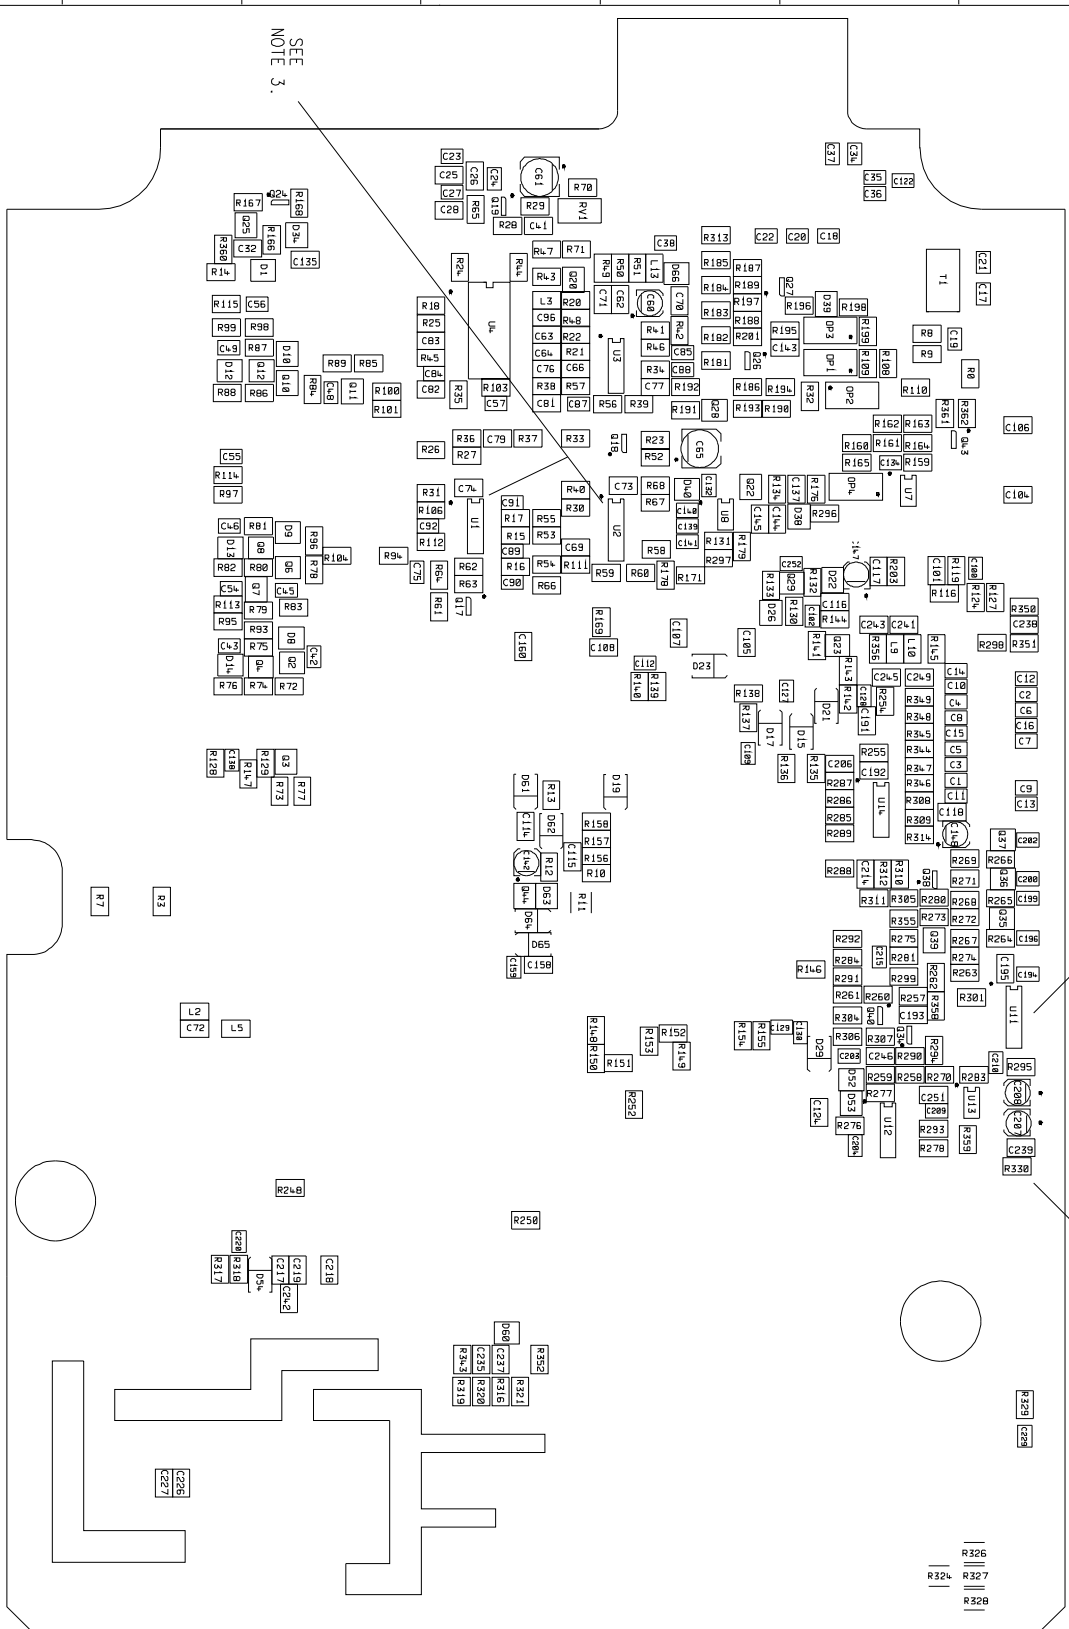


SURFACE MOUNT COMPONENT SIDE

- NOTES:
1. HAND SOLDER C216 ON TOP OF R330.
 2. LIFT U11 PIN 11 & CONNECT TO PIN2 USING SLEEVED LINK WIRE AS SHOWN BELOW:




- 3a. CUT TRACK BETWEEN U1 PIN 6 & U2 PIN 2 ON COMPONENT UNDERSIDE, THEN HAND SOLDER R117 ACROSS THE CUT TRACKS AS SHOWN BELOW:

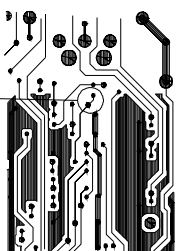

CUT TRACK

SOLDER R117
ON TO PADS

- 3b. HAND SOLDER C80 ACROSS U2 PINS
1 & 2 AS SHOWN BELOW:

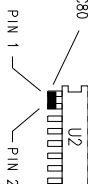

ISS	DESCRIPTION OF CHANGE	DATE
A	FINES ISSUE	SMO
B	ADDED 1035 TO CONVENTIONAL DAILY CHARGE C989,201.10 TO FIN. ECN NO. 4357-015/006 ADDED NOTE TO ADD CONNECTIONS REMOVED 41,2 ECN NO. 4357-015/006 ADDED NOTE TO ADD CONNECTIONS REMOVED 41,2 ECN NO. 4357-015/006 ADDED CONNECTION MODIFICATION FOR 411. ECN NO. 4357-015/006 ADDED NOTE TO ADD P&G C216. ECN NO. 4357-015/001	22.02.02
C	ADDED 102, 106 PLATE, NOTES 5-7 & MOVED 118 TO 104 ECN NO. 4357-015/012	SMO