






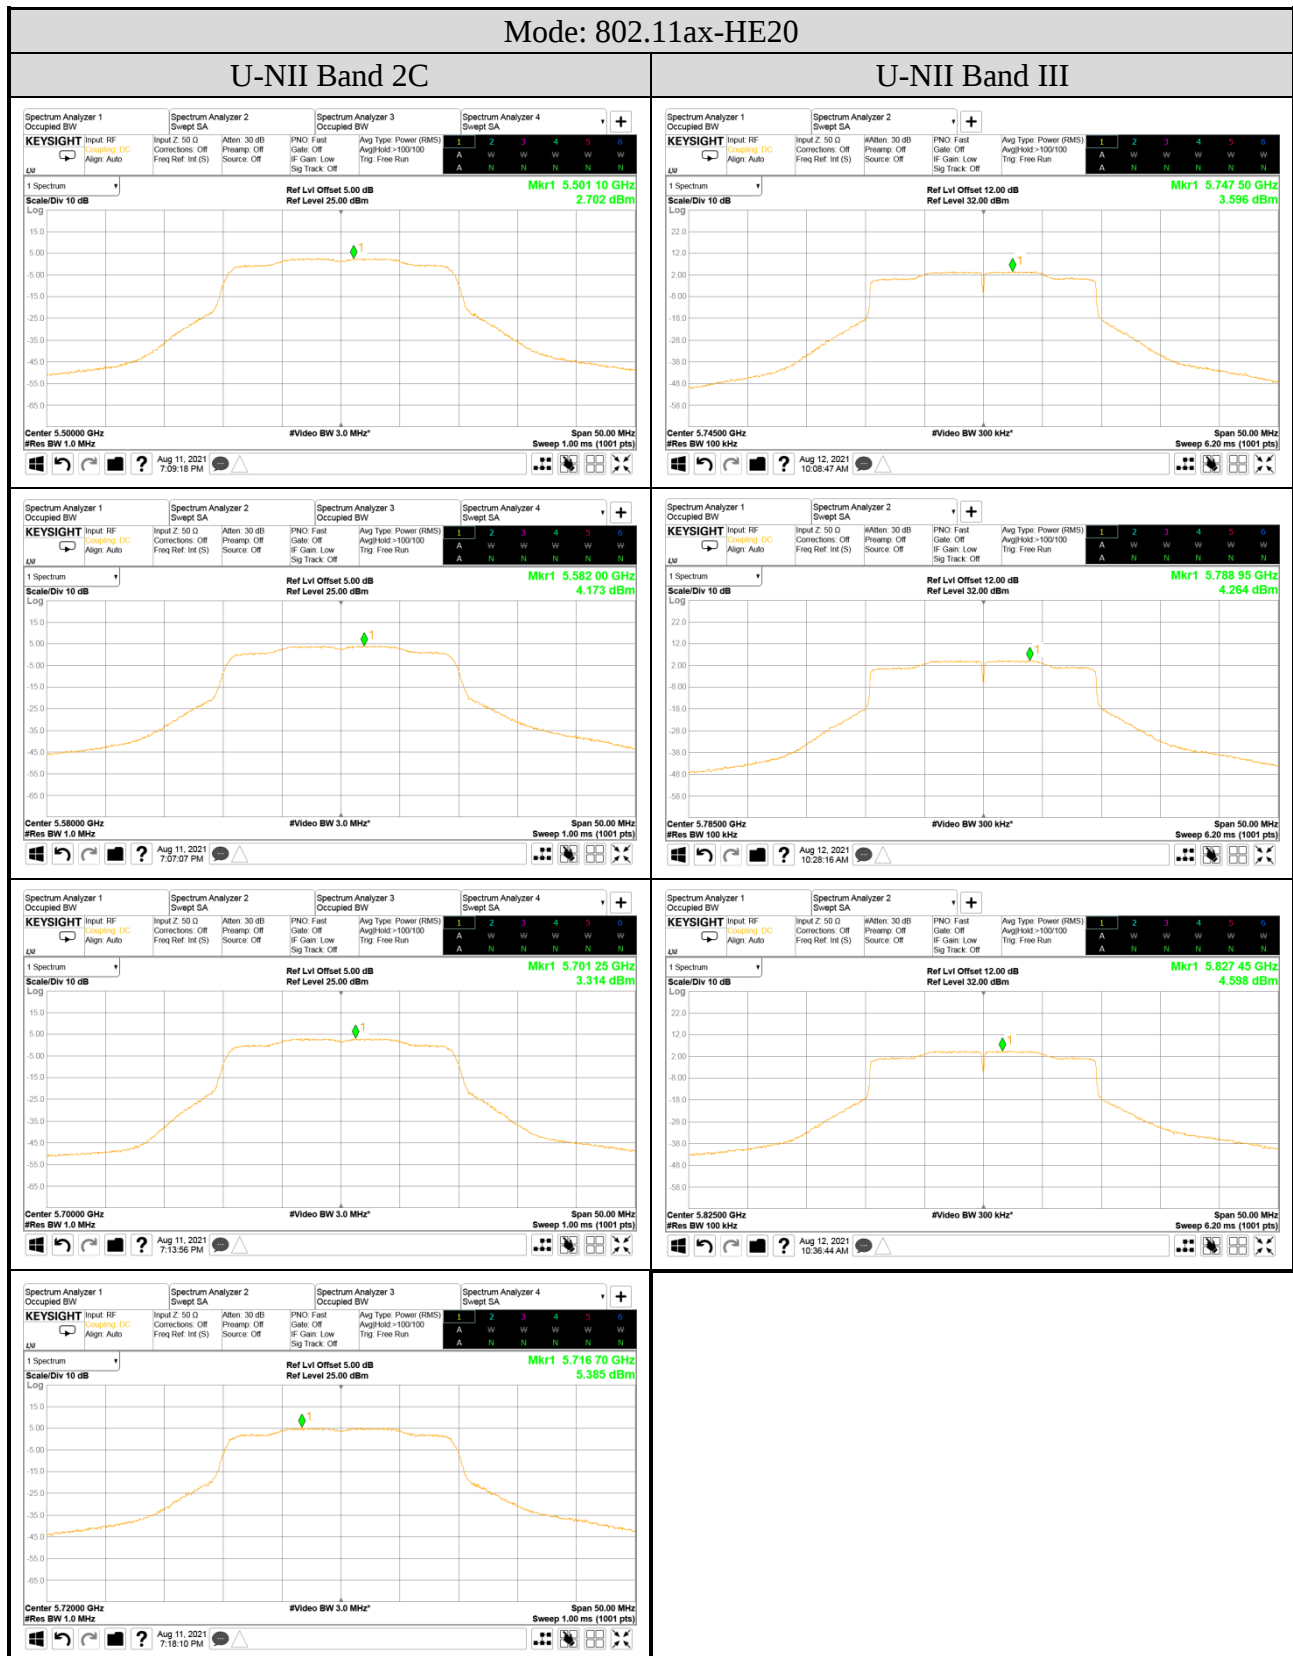


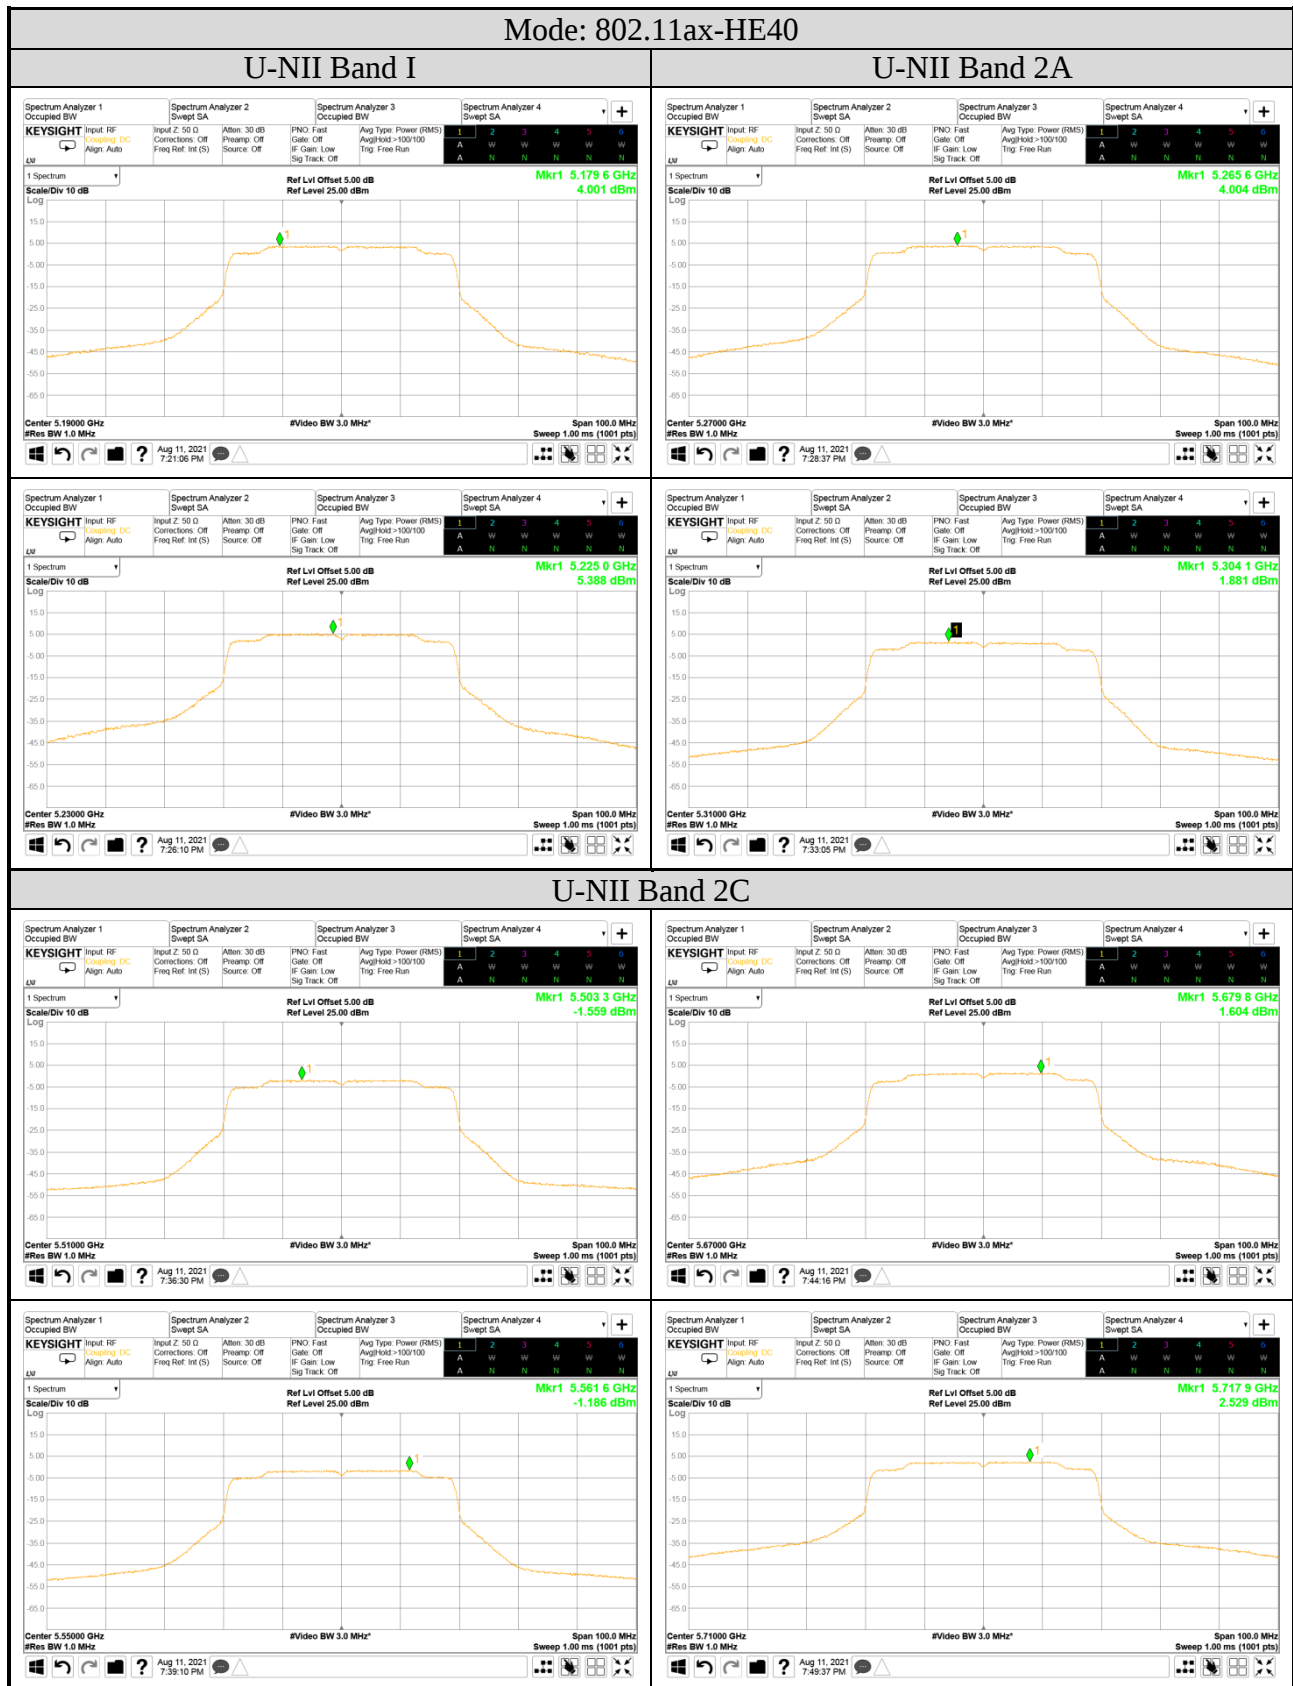


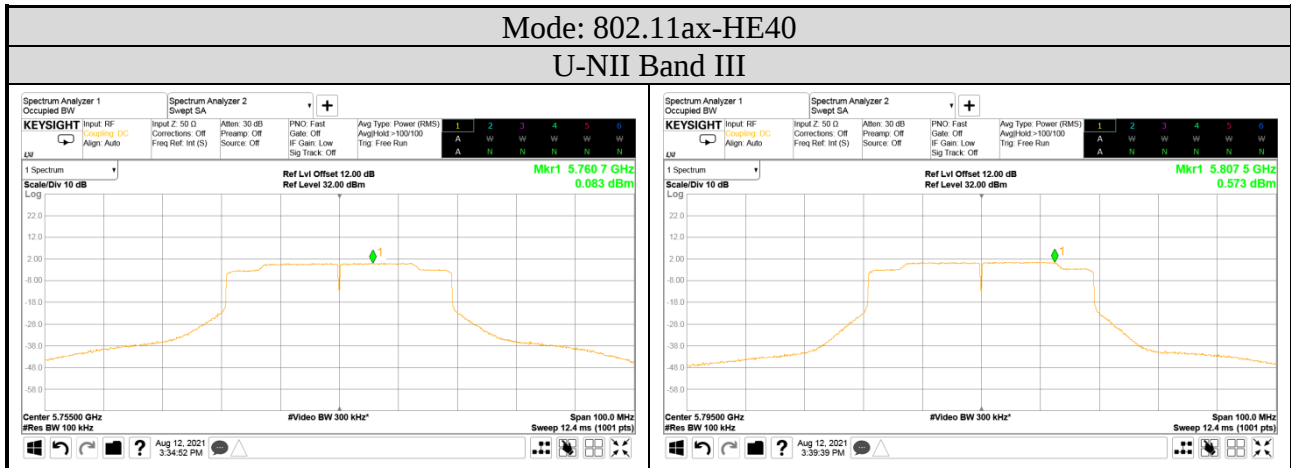


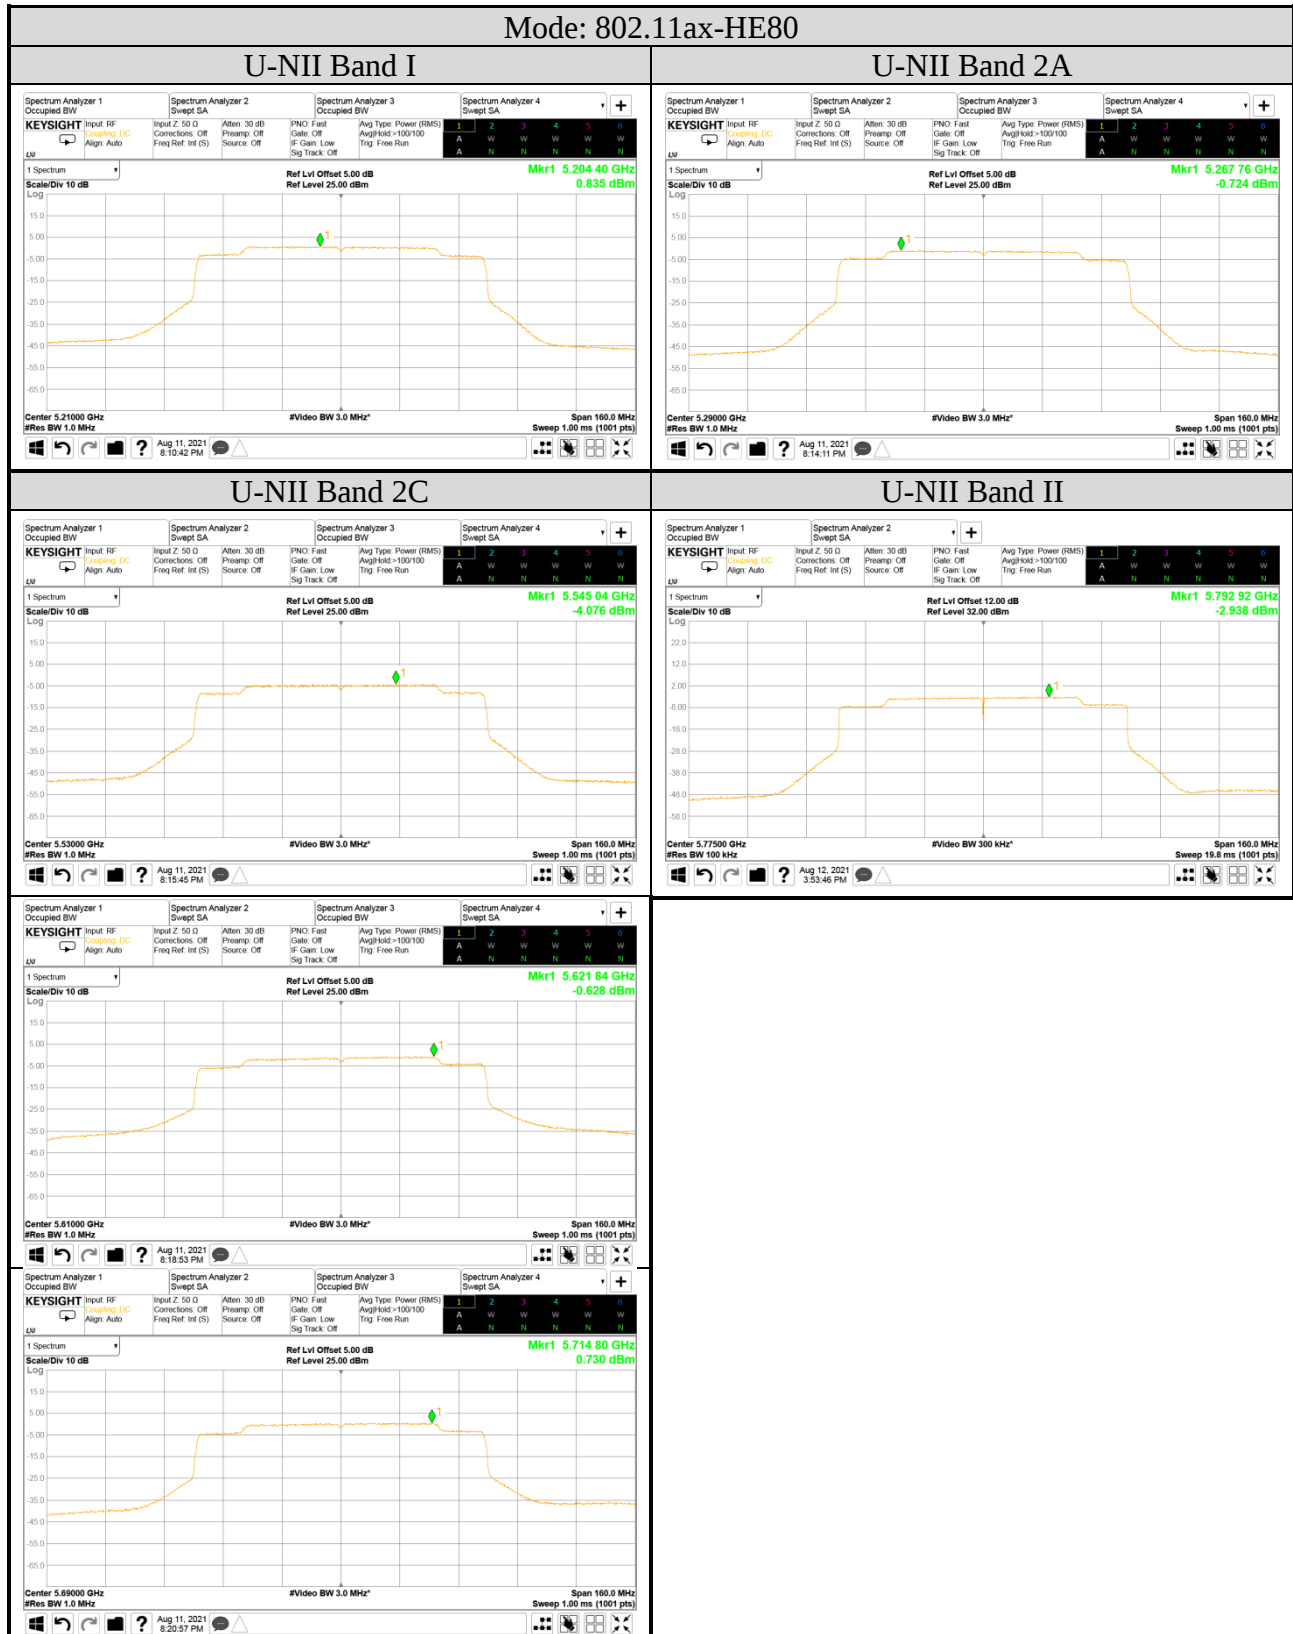

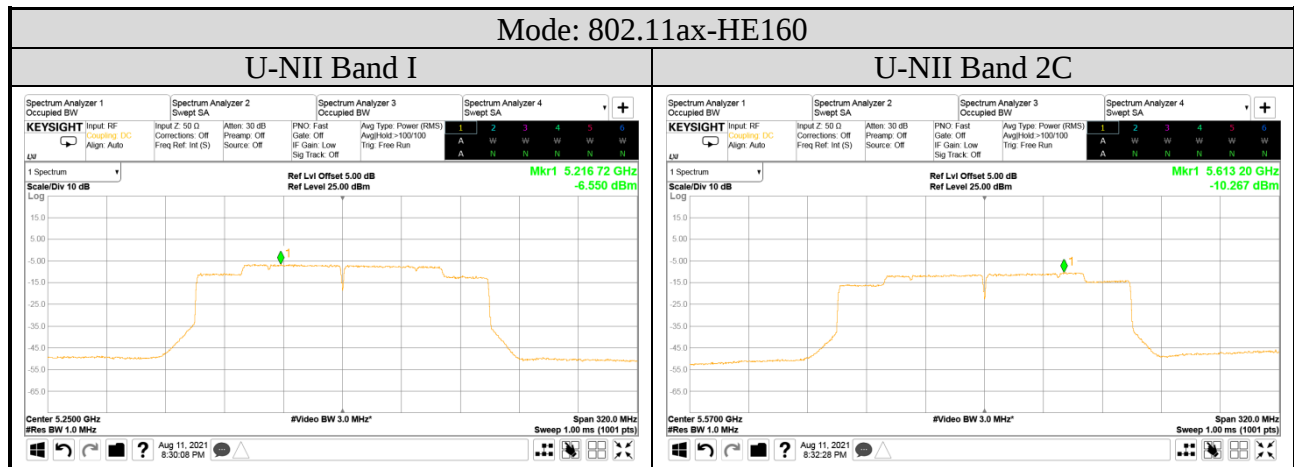

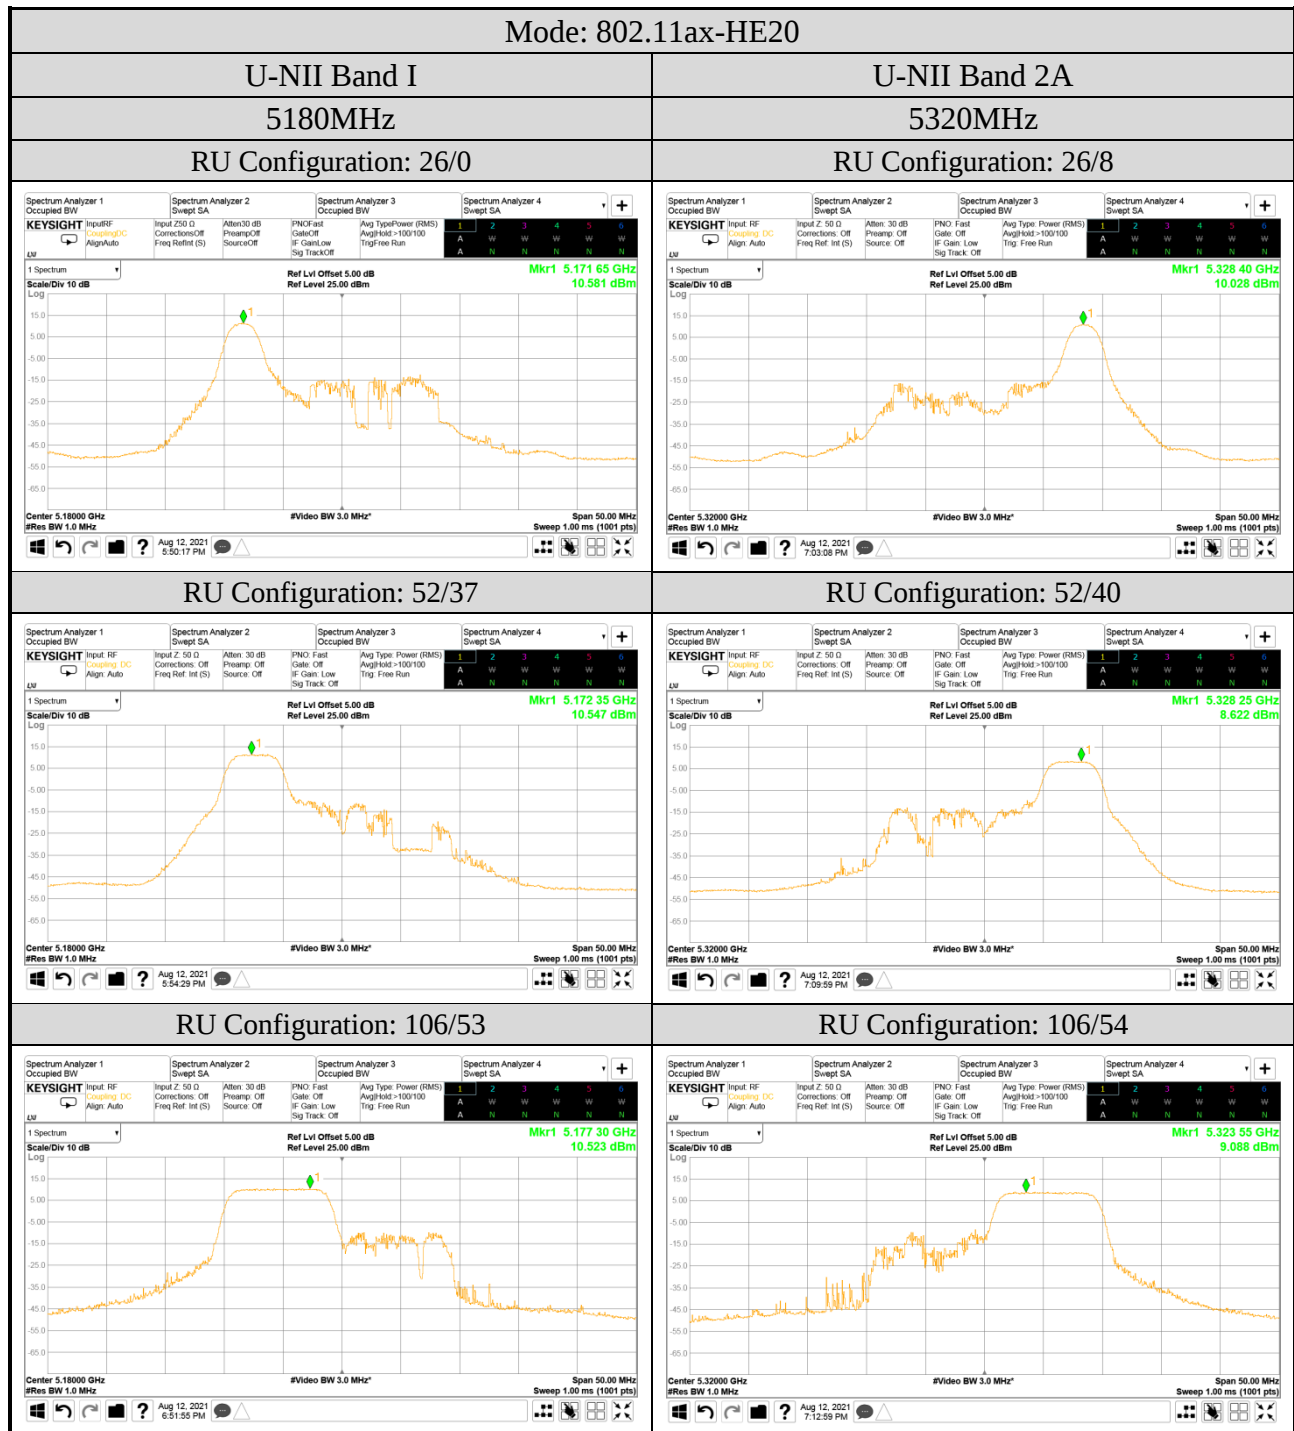


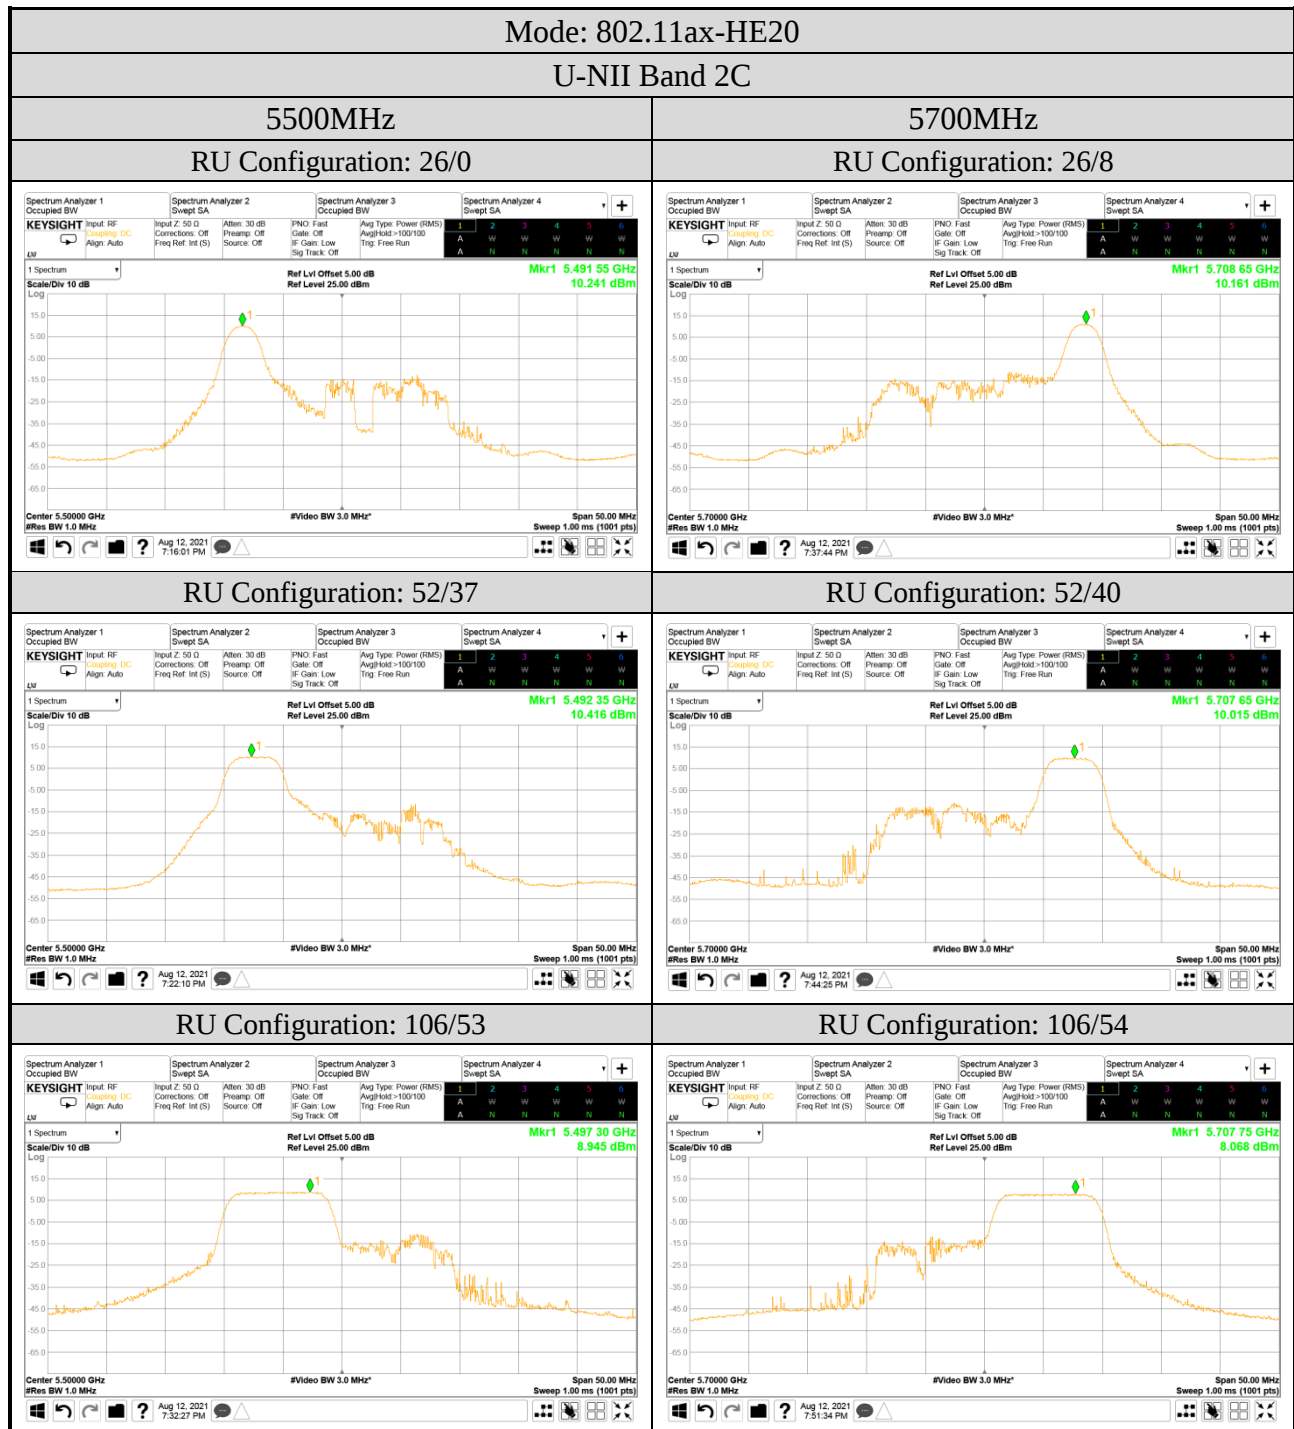

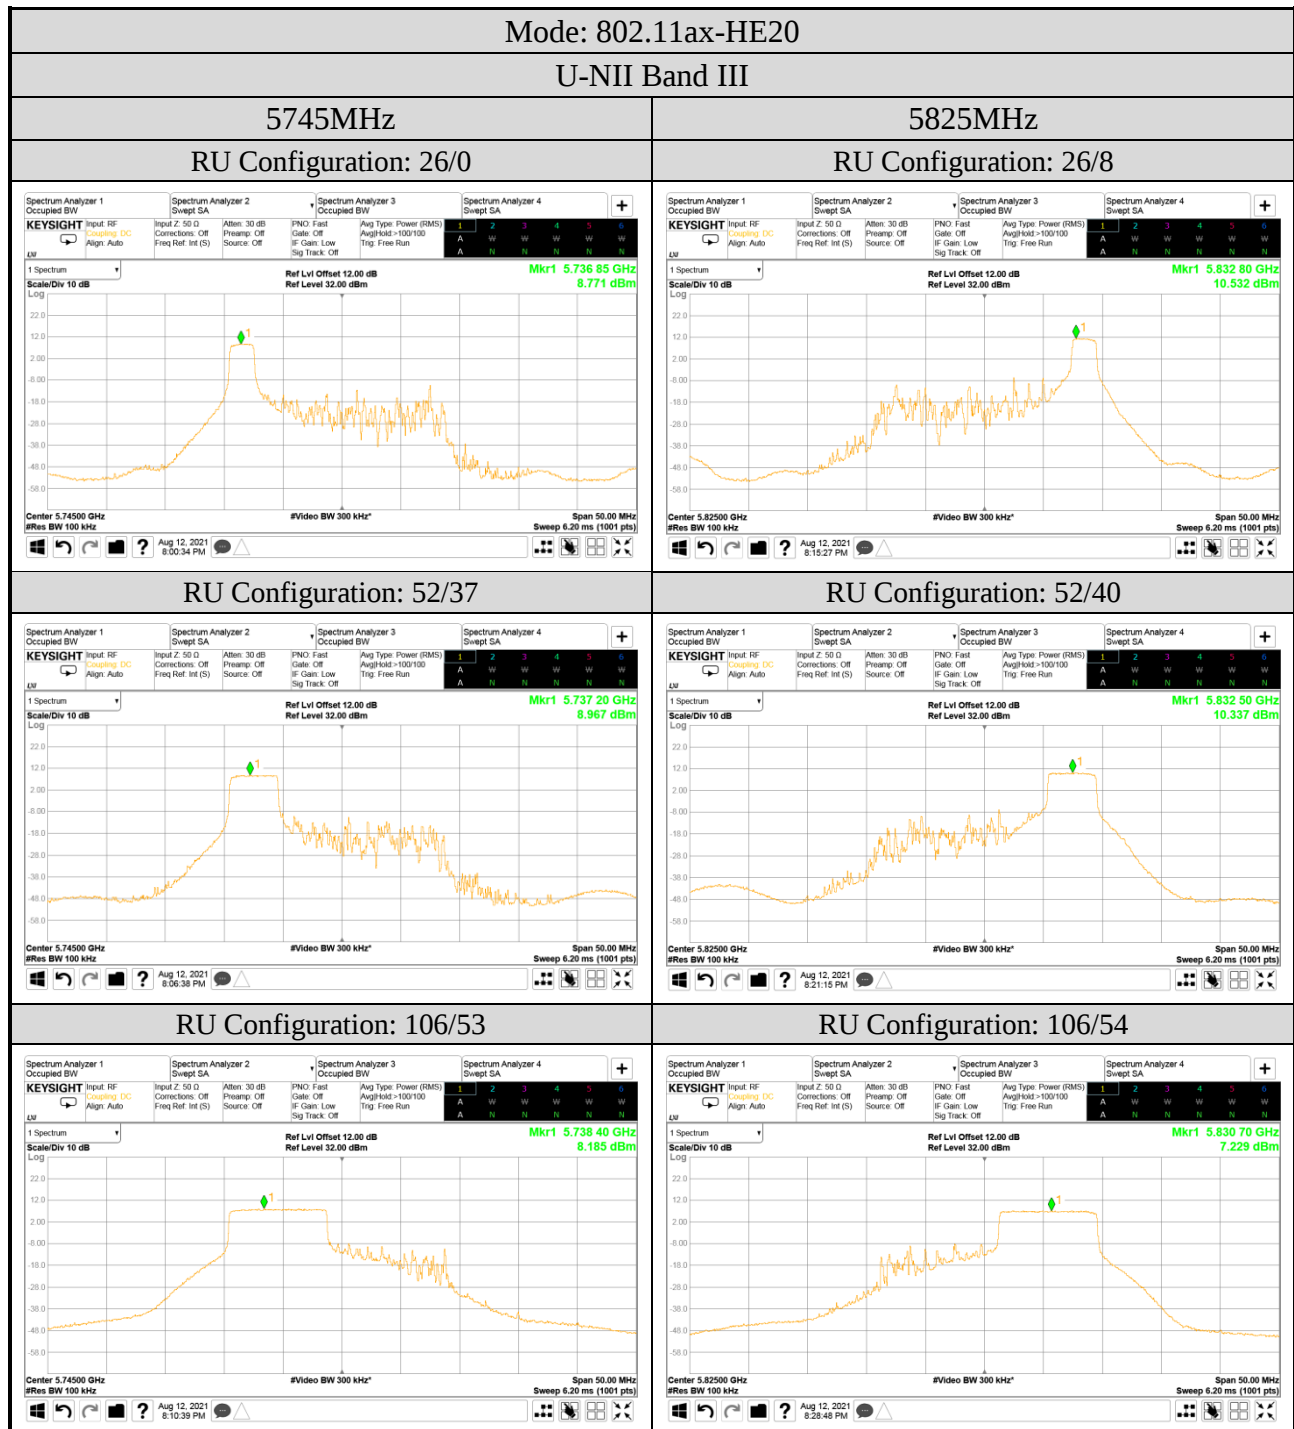


Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

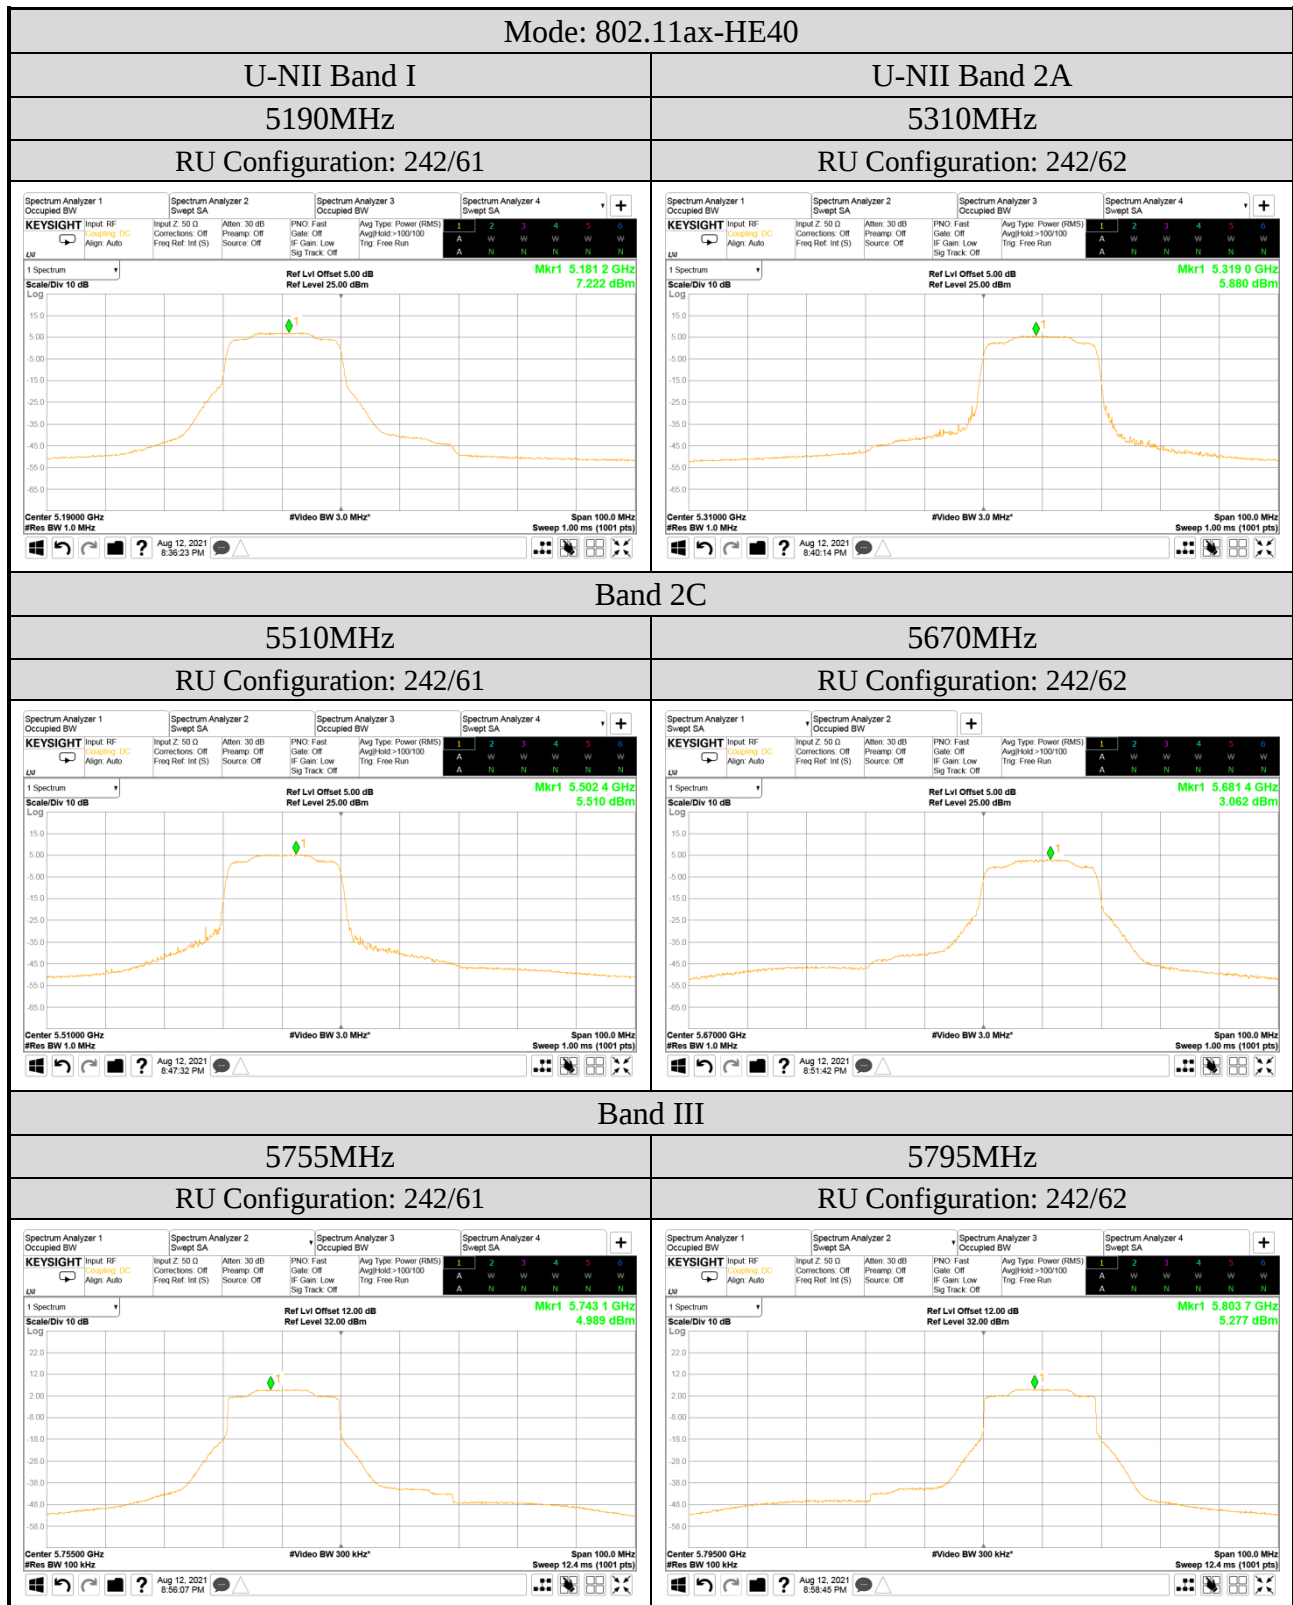


Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

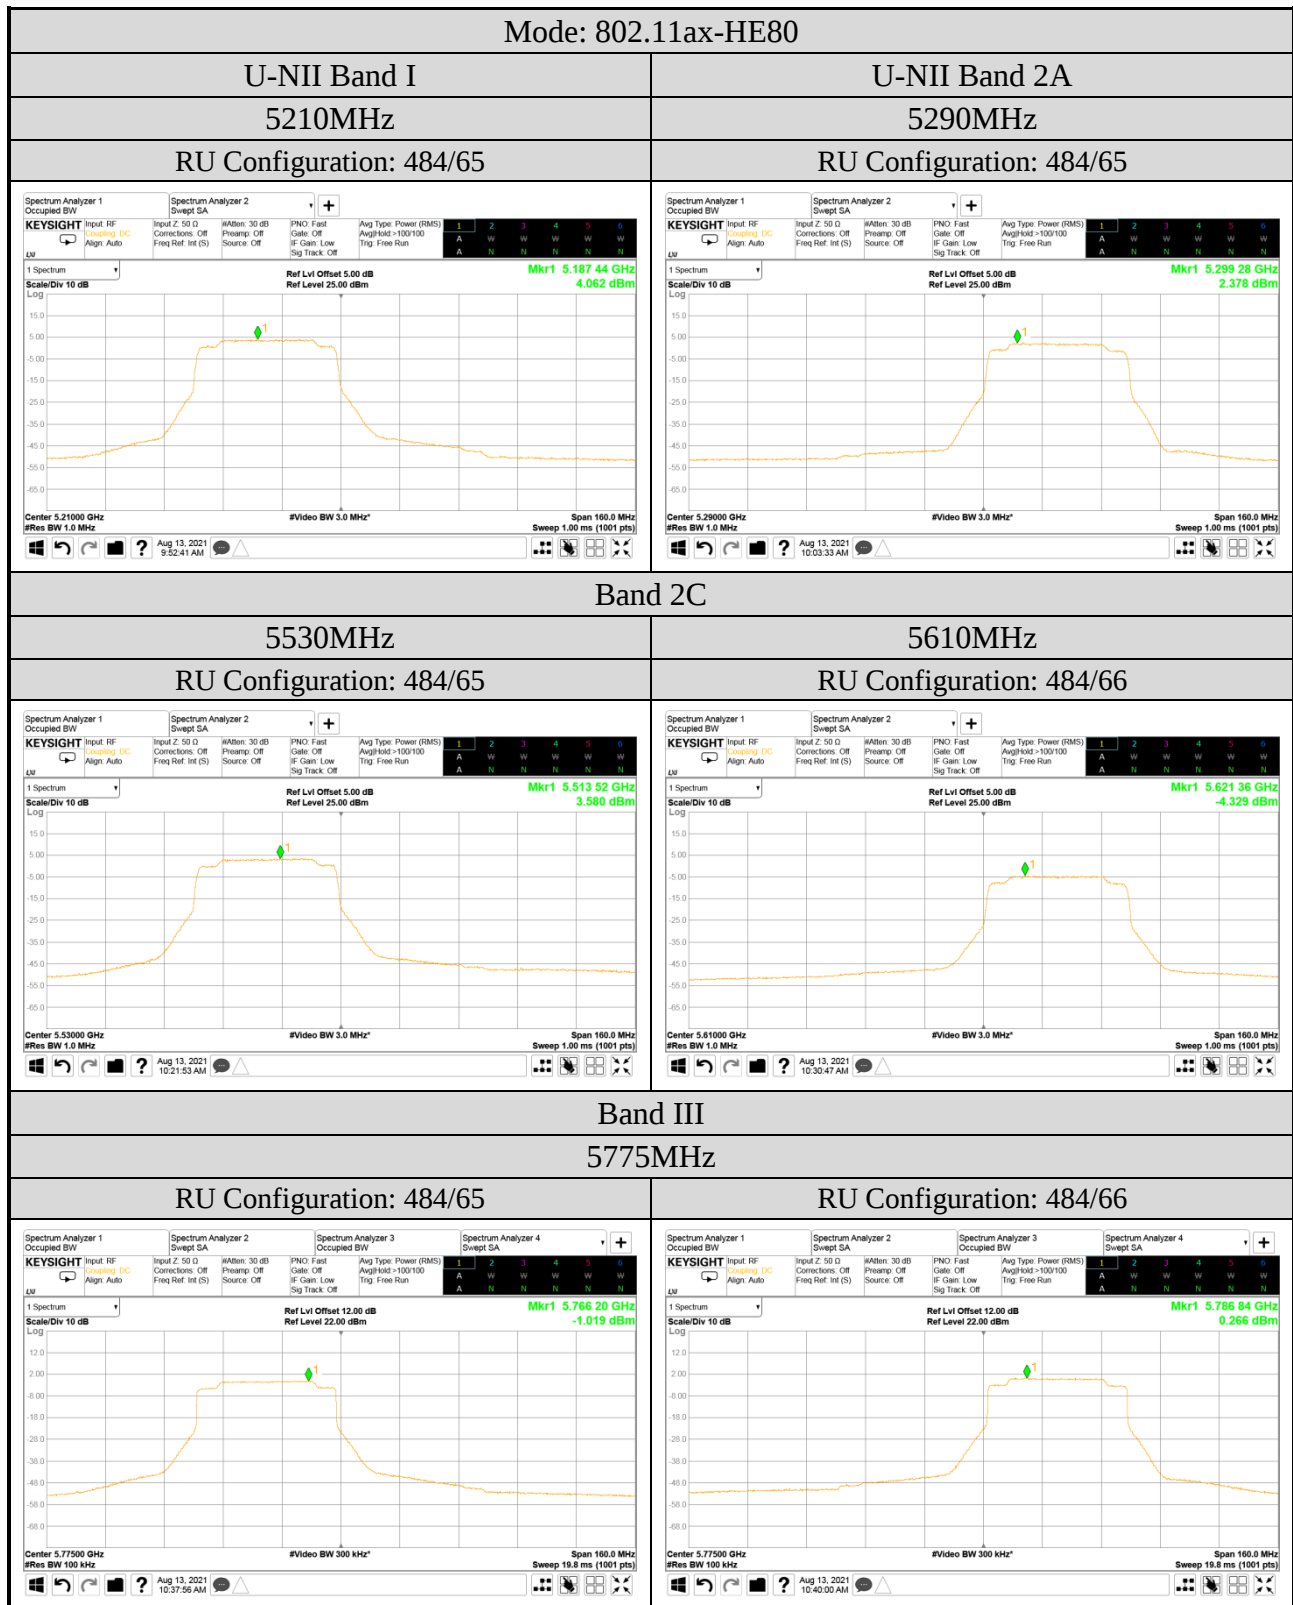

Audix Technology Corp.
No. 491, Zhongfu Rd., Linkou Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

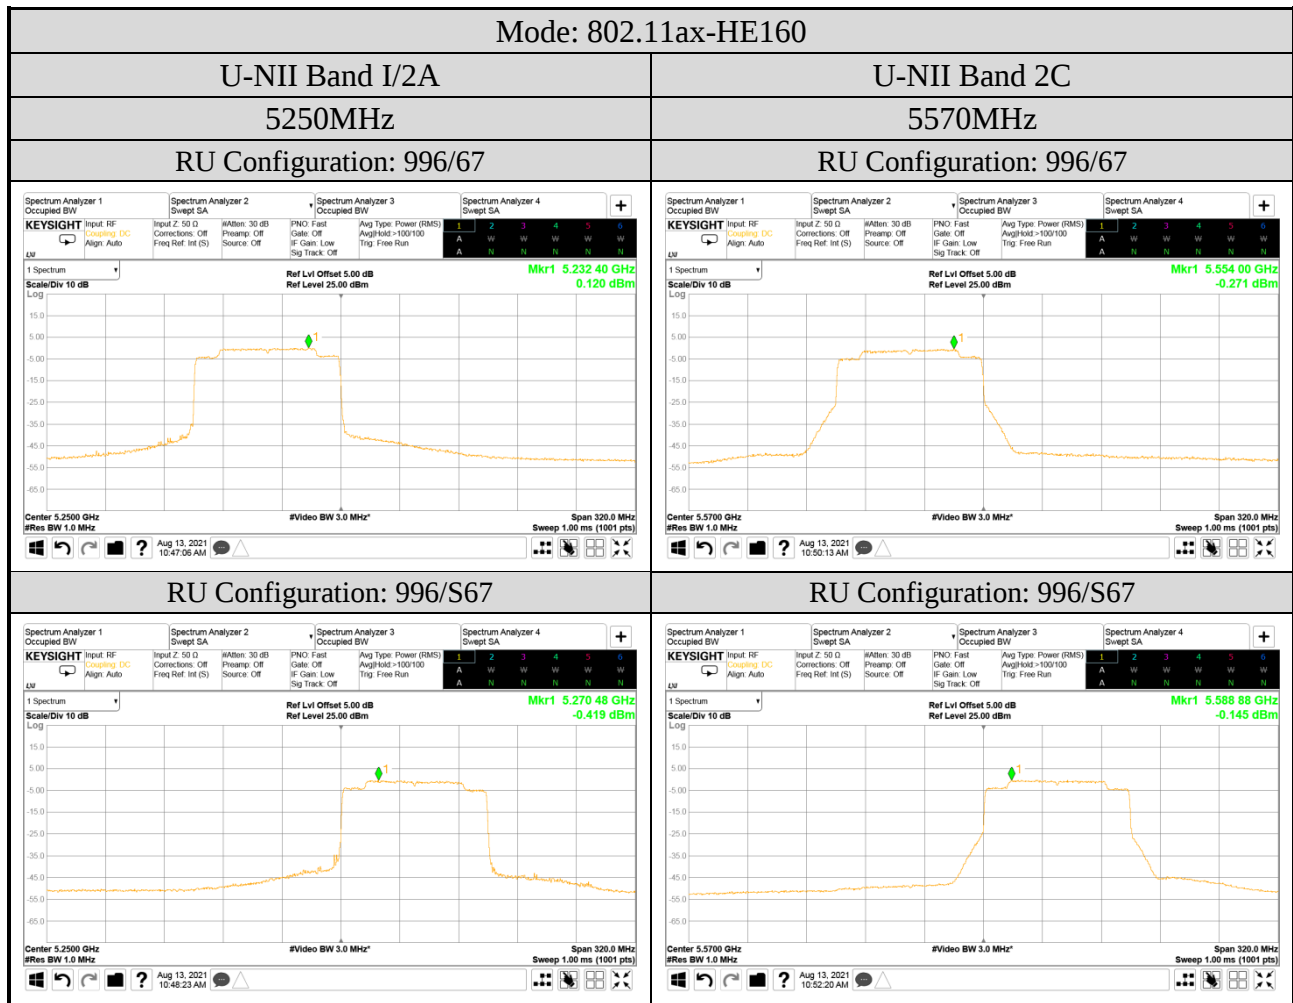

A.6 FREQUENCY STABILITY

Test Date	2021/08/12	Temp./Hum.	24°C/54%
Cable Loss	---	Tested By	Sean Wang
Test Voltage	AC 120V 60Hz (Via AC Adapter)		

A.6.1 Frequency stability Result

Temperature (°C)	Voltage (Vac)	Centre Frequency (MHz)	Measurement Value (MHz)	Frequency Stability (ppm)
25	120	5180	5180.011	2.124
-30	102		5180.009	1.737
	138		5179.988	-2.317
-20	102		5179.974	-5.019
	138		5179.985	-2.896
-10	102		5180.024	4.633
	138		5179.994	-1.158
0	102		5180.012	2.317
	138		5179.995	-0.965
10	102		5179.989	-2.124
	138		5180.006	1.158
20	102		5179.997	-0.579
	138		5180.01	1.931
30	102		5180.008	1.544
	138		5180.004	0.772
40	102		5180.006	1.158
	138		5180.018	3.475
50	102		5180.013	2.510
	138		5180.022	4.247