

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

FCC Test Report

External Radio Frequency Power Amplifier (ERFPA) Part 22 and part 24

Product Name: COILER MINI AMPLIFIER

FCC ID: RFJCB-127

Applicant:

**TAIWAN COILER INTERNATIONAL CORP.
8F-4, NO. 75, SEC. 1, HSIN TAI WU ROAD
HSI-CHIH CITY TAIPEI HSIEN 221
TAIWAN**

Date Receipt: APRIL 21, 2004

Date Tested: MAY 3, 2004

PLEASE NOTE: THE ATTACHED REPORT SHALL NOT BE REPRODUCED EXCEPT IN FULL
WITHOUT THE WRITTEN APPROVAL OF TIMCO ENGINEERING, INC.

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZ0\186AUT3\186AUT3TestReport.doc

COVER PAGE

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

TABLE OF CONTENTS

COMPLIANCE STATEMENT:	2
GENERAL INFORMATION REQUIRED FOR TYPE ACCEPTANCE	3
2.1046(a) RF power output:	5
2.1049 Input/Output modulated amplitude comparison.....	6
2.1051, 22.917 (f) and 24(E) Out of band emissions:	10
2.1051 Spurious emissions at antenna terminals:.....	15
Method of Measuring Conducted Spurious Emissions	17
Out of Band Rejection: Filter frequency response plots.....	18
2.1053 Field strength of spurious emissions:	20
Method of Measuring Radiated Spurious Emissions	21
Equipment List	22

EXHIBITS INCLUDING:

BLOCK DIAGRAM
SCHEMATIC
PARTS LIST
USERS MANUAL
LABEL SAMPLE
LABEL LOCATION
EXTERNAL PHOTOGRAPHS
INTERNAL PHOTOGRAPHS
TUNING PROCEDURE
OPERATIONAL DESCRIPTION
TEST SET UP PHOTOGRAPHS

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZ0\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

COMPLIANCE STATEMENT:

This equipment has been tested in accordance with the standards identified in this test report. To the best of my knowledge and belief, these tests were performed using the measurement procedures described in this report and demonstrate that the equipment complies with the appropriate standards. No modifications were made to the equipment during testing in order to demonstrate compliance with these standards.

I attest that the necessary measurements were made, under my supervision, at TIMCO ENGINEERING, INC. located at 849 N.W. State Road 45, Newberry, Florida 32669.

Authorized Signatory Name: Bruno Clavier

Signature: <onfile>

Function: Chief Engineer

Date: 05/03/04

Test engineer name: Nam Nguyen

Signature: <onfile>

Date: 05/03/04

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZ0\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

GENERAL INFORMATION REQUIRED FOR TYPE ACCEPTANCE

2.1033(c)(1)(2)

TAIWAN COILER INTERNATIONAL CORP.
8F-4, NO. 75, SEC. 1, HSIN TAI WU ROAD
HSI-CHIH CITY, TAIPEI HSIEN 221 TAIWAN

2.1033(c) TECHNICAL DESCRIPTION

2.1033(c)(3) User Manual. See the exhibits.

2.1033(c)(4) Type of Emission: 1M25F9W (CDMA IS-95)

99 % Power bandwidth = 1.25 MHz
Bn = 1.25 MHz

Type of Emission: F9W (CDMA)

2.1033(c)(5) Frequency Range: 824-849 MHz and 1850-1910MHz

2.1033(c)(6) Power Range and Controls: There are NO user Power controls.

2.1033(c)(7) Maximum Output and Input Power Rating per manufacturer specifications:

Max rated input and output powers (UP-LINK)

SYSTEM	MAX INPUT POWER	MAX OUTPUT POWER	DC POWER
CDMA	+25dBm	+33dBm(Typ.)	12V / 1.7A
		+30dBm(Min)	
PCS	+13.5dBm	+30dBm(Typ.)	12V / 0.93A
		+27dBm(Min)	

Our product won't beyond the maximum input power that we declare in the real application

Max rated input and output powers (DW-LINK)

SYSTEM	MAX INPUT POWER	MAX OUTPUT POWER	DC POWER
CDMA	-10dBm	+0dBm	12V / 0.23A
PCS	-10dBm	+0dBm	12V / 0.23A

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZ0\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

- 2.1033(c)(8) DC Voltages and Current into Final Amplifier:
- POWER INPUT FINAL AMPLIFIER ONLY
(see above section)
- 2.1033(c)(9) Tune-up procedure. The tune-up procedure is given in the exhibits.
- 2.1033(c)(10) Complete Circuit Diagrams: Description of all circuitry and devices provided for determining and stabilizing frequency is included in the circuit description in the instruction manual. The circuit diagram and block diagram are included in the exhibits.
- 2.1033(c)(11) A photograph or drawing of the equipment identification label is shown in the exhibits.
- 2.1033(c)(12) Photographs of the equipment of sufficient clarity to reveal equipment construction and layout and label location are shown in the exhibits.
- 2.1033(c)(13) For equipment employing digital modulation, a detail description of the modulation technique: N/A as this device is an amplifier
- 2.1033(c)(14) Data required for 2.1046 to 2.1057 See Next Page.

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669


<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1046(a) RF power output:

RF power is measured by connecting a 50 ohm, resistive wattmeter to the RF output connector. With a nominal voltage of 12 VDC using the AC/DC switched mode power supply specified with this device, and the transmitter properly adjusted the RF output measures:

METHOD OF MEASURING RF POWER OUTPUT

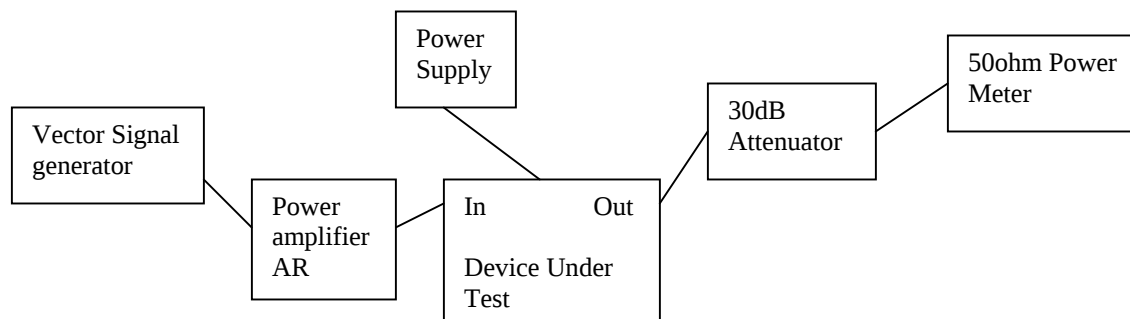

CONDUCTED POWER:

Tuned Frequency (MHz)	Power Input (dBm)	Power Output (dBm)	Power Output (W)
824.70	25.0	31.8	1.514
835.40	25.0	31.4	1.38
848.31	25.0	31.4	1.38
1851.25	13.5	30.6	1.148
1880.00	13.5	31.0	1.259
1908.75	13.5	31.2	1.318

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZ0\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1049 **Input/Output modulated amplitude comparison**

The Reference level was calibrated using a 3MHz RBW=VBW.

NOTES:

Input vs. Output for 824.7MHz

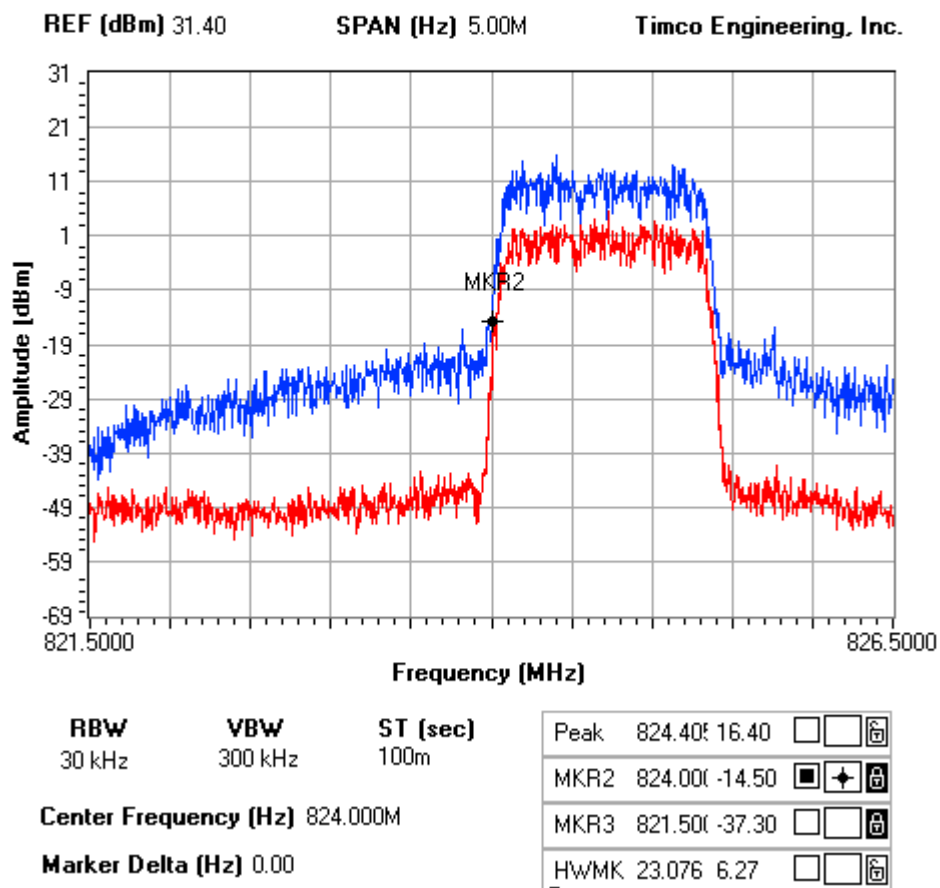


Figure 1: CDMA modulation – In vs. Out 824.7MHz

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

NOTES:

Input vs. Output for 848.31MHz

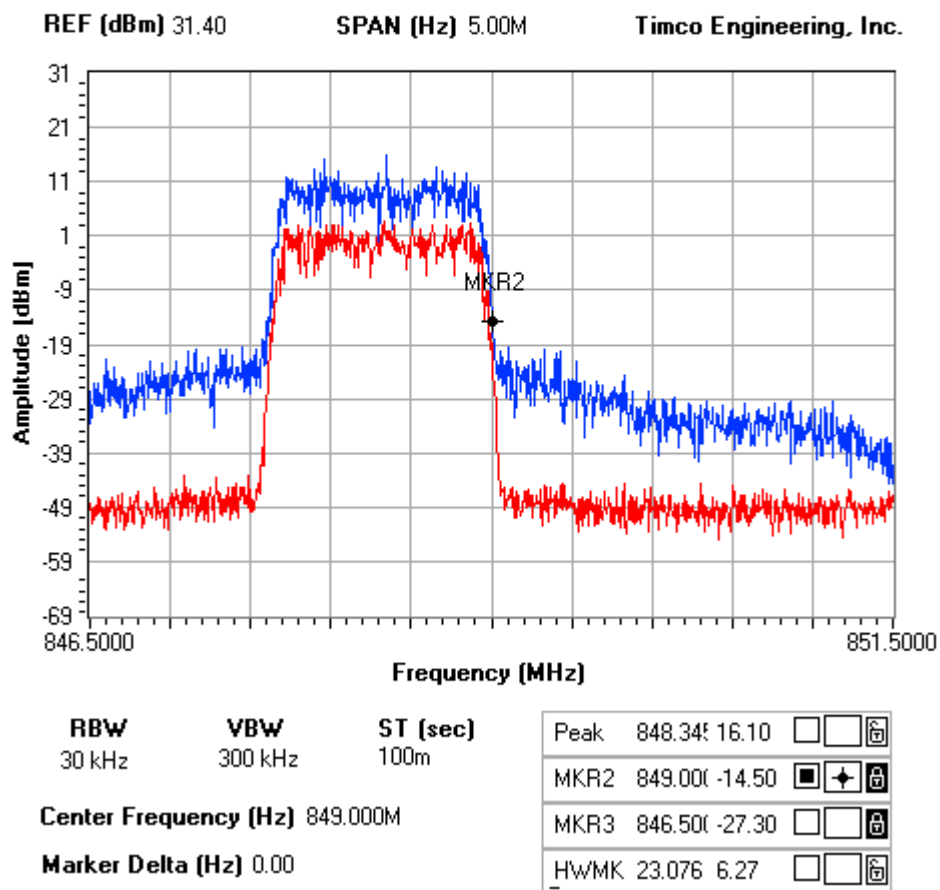


Figure 2: CDMA modulation – In vs. Out 848.31MHz

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

NOTES:

RF input at 13.8dBm
in vs. out at 1850MHz

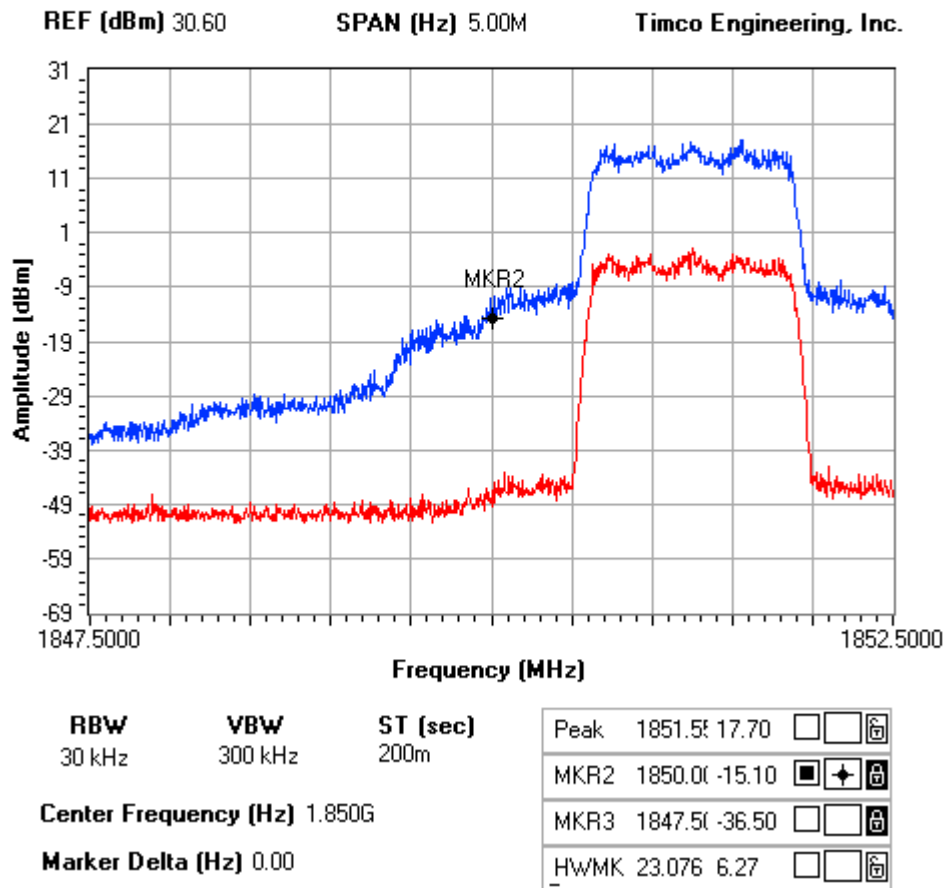


Figure 3: CDMA modulation – In vs. Out 1851.25MHz

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

NOTES:

RF input at 13.8dBm
in vs. out at 1910MHz

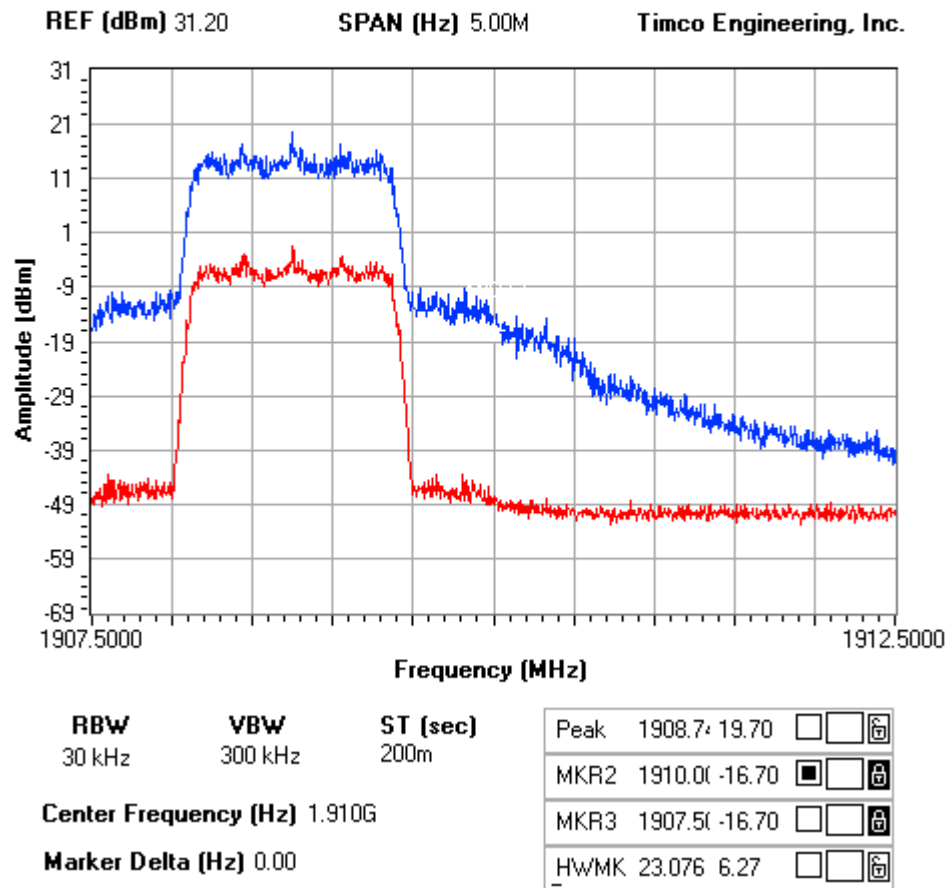


Figure 4: CDMA modulation – In vs. Out 1908.75MHz

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1051, 22.917 (f) and 24(E) Out of band emissions:

The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitting power (P) by a factor of at least $43 + 10 \log(P)$ dB.

Band-edges compliance: Measurement were performed in accordance with Part 22.917 (h) and part 24(E)

Channel (MHz)	Band-edge Frequency (MHz)	Amplitude level at the band-edge (dBm)	Limit (dBm)	Margin (dB)
824.70	824	-14.0	-13.0	-1.0
848.31	849	-14.5	-13.0	-1.5
1851.25	1850	-13.6	-13.0	-0.6
1908.75	1910	-15.6	-13.0	-2.6

The Reference level on the following plots was calibrated using a 3MHz RBW=VBW.

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

NOTES:

band edge for 824.7MHz

level is -14.0dBm

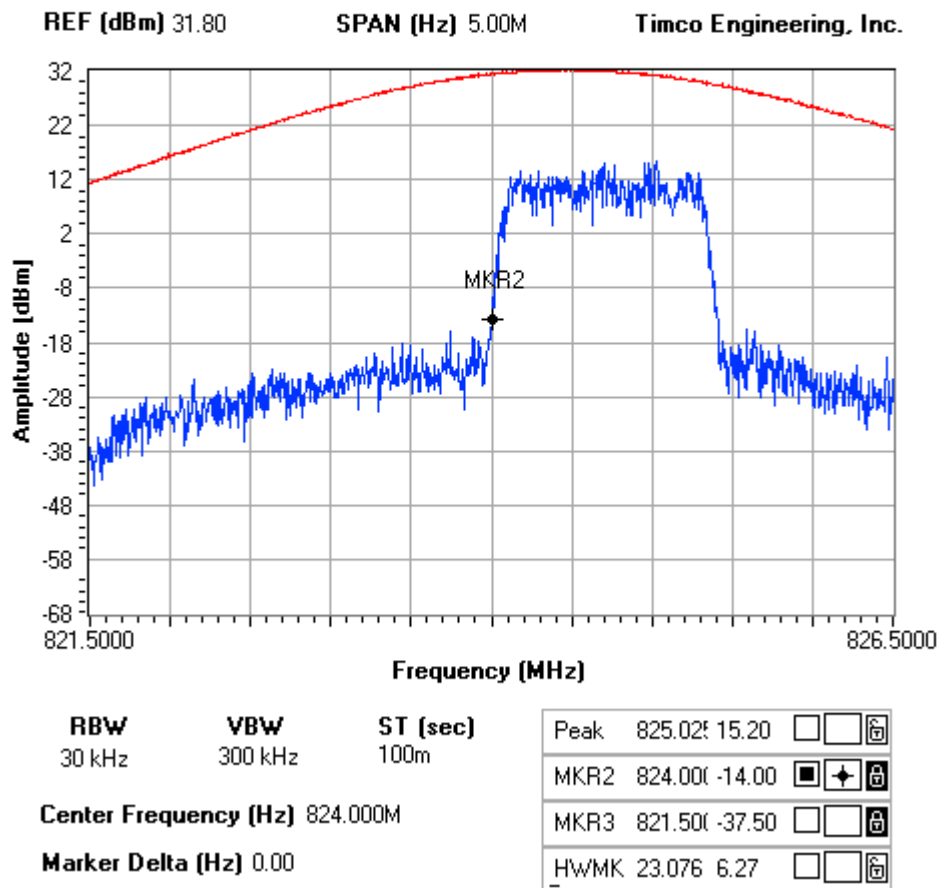


Figure 5: Band edge at 824MHz

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

NOTES:

849MHz band edge

Level is -14.5dBm

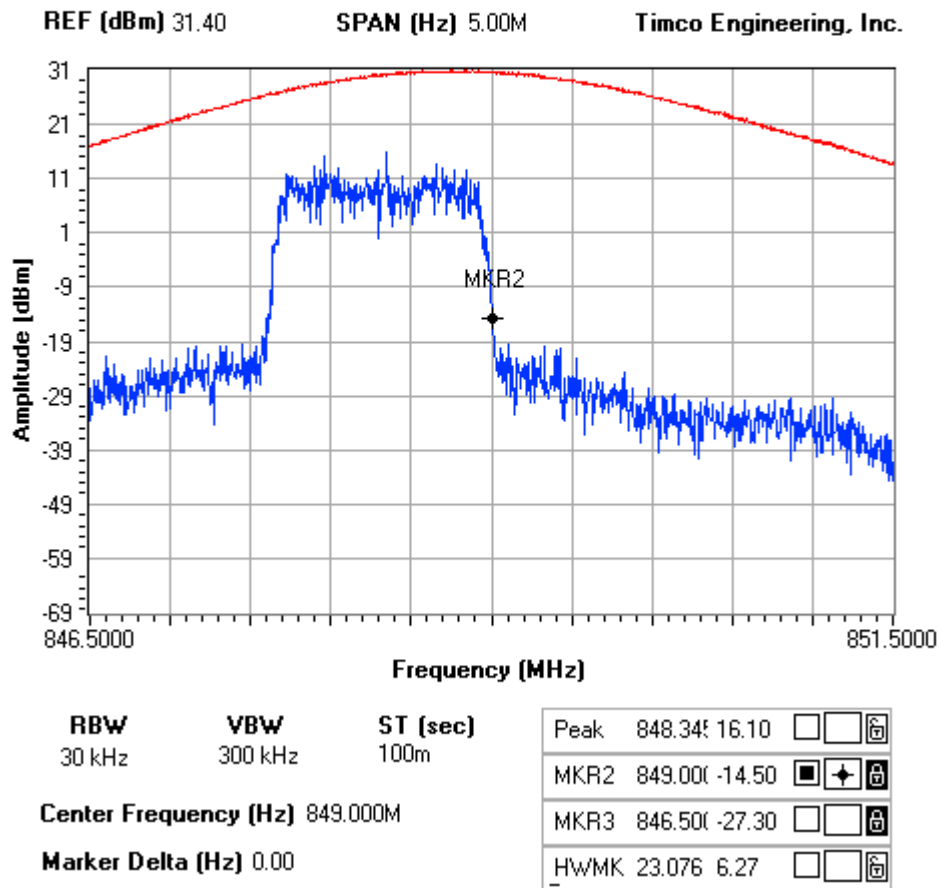


Figure 6: Band-edge at 849MHz

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

NOTES:

RF input at 13.8dBm

level at band edge is -13.6dBm

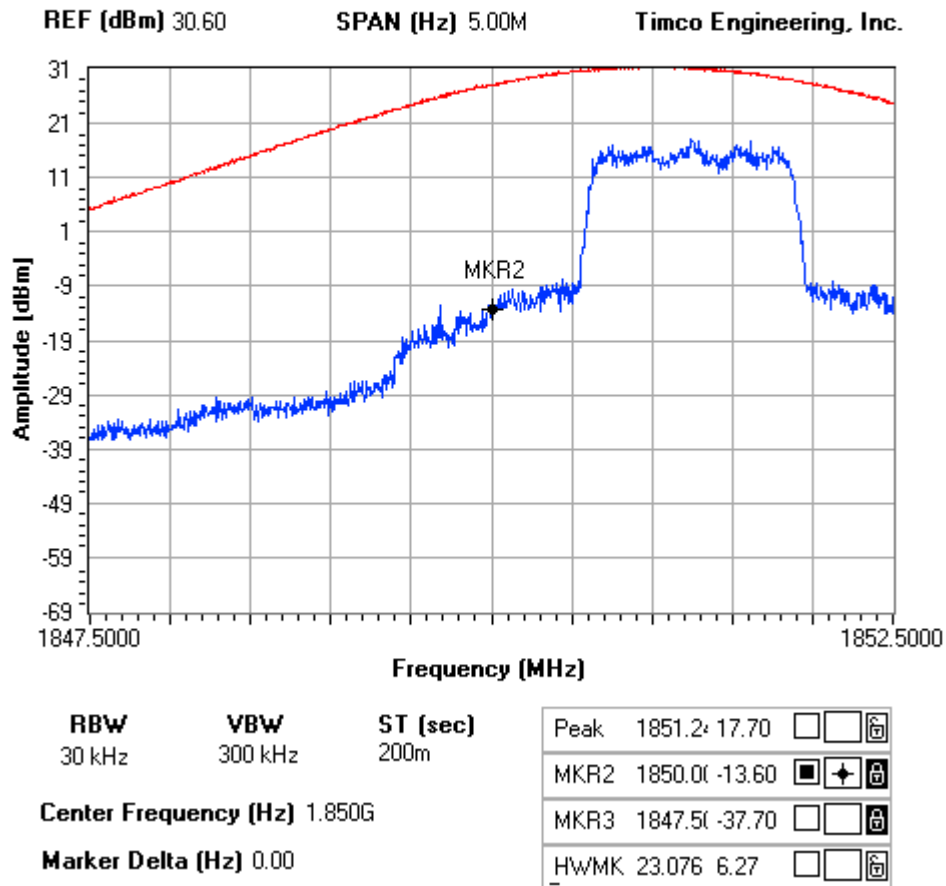


Figure 7: Band edge at 1850MHz

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

NOTES:

RF input at 13.8dBm

band edge at 1910MHz

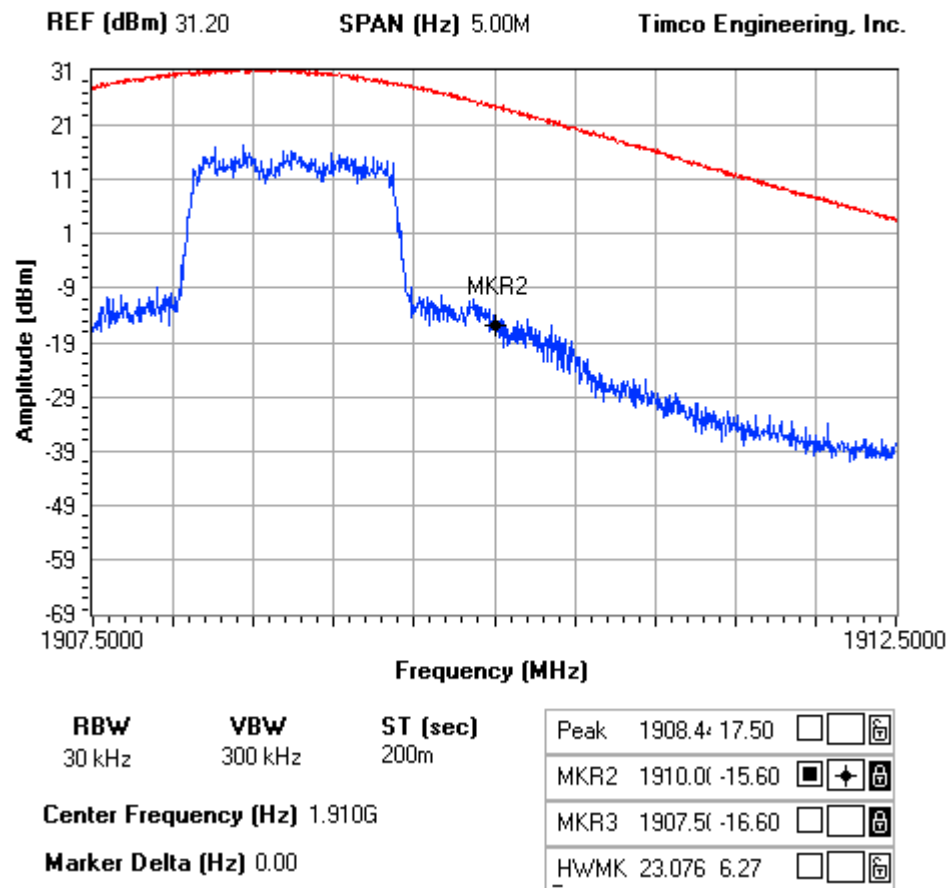


Figure 8: Band edge at 1910MHz

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1051

Spurious emissions at antenna terminals:

Data on the following page shows the level of conducted spurious responses. For analog modulation, the carrier was modulated 100% using a 2500 Hz tone. For digital modulation, the carrier is modulated to its maximum extent. The spectrum was scanned from 9kHz to at least the 10th harmonic of the fundamental. The measurements were made in accordance with standard TIA/EIA-603.

REQUIREMENTS:

Emissions must be 43 +10log(Po) dB below the mean power output of the transmitter:

$$43 + 10\log(1.514) = 44.8 \text{ dBc}$$

The maximum conducted power was measured at 1.514 Watt for 850MHz band.

TEST DATA:

EMISSION FREQUENCY MHz	dB BELOW CARRIER (dBc)
824.7	0
1649.4	52.8
2474.1	<64.8
3298.8	<64.8
4123.5	<64.8
4948.2	<64.8
5772.9	<64.8
6597.6	<64.8
7422.3	<64.8
8247	<64.8
835.4	0
1670.8	<64.8
2506.2	<64.8
3341.6	<64.8
4177	<64.8
5012.4	<64.8
5847.8	<64.8
6683.2	<64.8
7518.6	<64.8
8354	<64.8
848.31	0
1696.62	50.9
2544.93	<64.8
3393.24	<64.8
4241.55	<64.8
5089.86	<64.8
5740	<64.8
6560	<64.8
7380	<64.8
8200	<64.8

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

REQUIREMENTS: Emissions must be $43 + 10\log(P_o)$ dB below the mean power output of the transmitter.

$$43 + 10\log(1.318) = 44.2 \text{ dBc}$$

The maximum conducted power was measured at 1.318 Watt for PCS band.

TEST DATA:

EMISSION FREQUENCY MHz	dB BELOW CARRIER (dBc)
1851.25	0
3702.5	<64.2
5553.75	<64.2
7405	<64.2
9256.25	<64.2
11107.5	<64.2
12958.75	<64.2
14810	<64.2
16661.25	<64.2
18512.5	<64.2
1880	0
3760	<64.2
5640	<64.2
7520	<64.2
9400	<64.2
11280	<64.2
13160	<64.2
15040	<64.2
16920	<64.2
18800	<64.2
1908.75	0
3817.5	<64.2
5726.25	<64.2
7635	<64.2
9543.75	<64.2
11452.5	<64.2
13361.25	<64.2
15270	<64.2
17178.75	<64.2
19087.5	<64.2

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.


849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

Method of Measuring Conducted Spurious Emissions

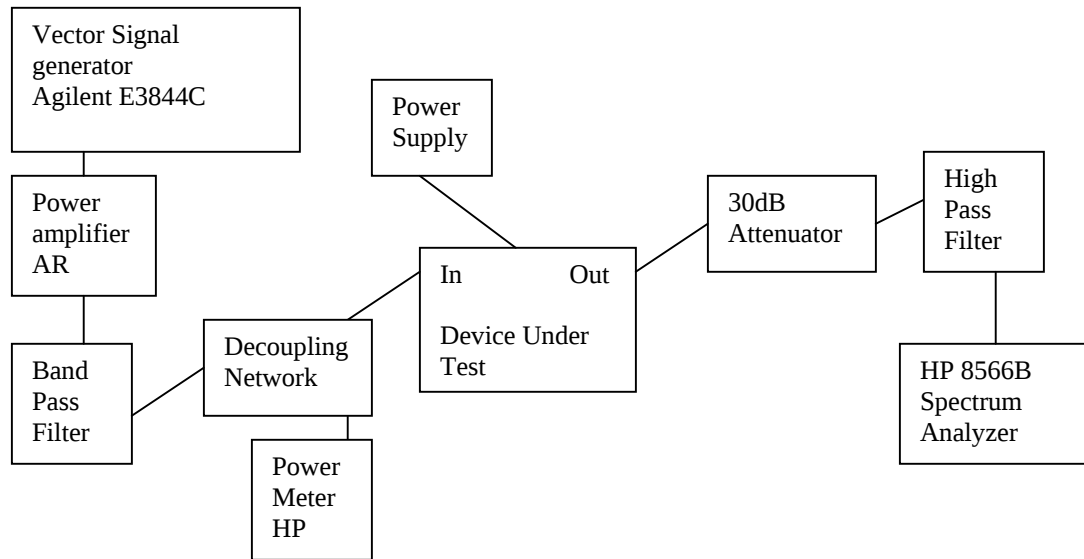

The following test equipment was used:

- (1) Agilent E4436B: dual-mode baseband generator(arbitrary waveform and real-time I/Q) 250 kHz to 3 GHz

METHOD OF MEASUREMENT: The procedure used was TIA/EIA-603 STANDARD. The spectrum was scanned from 9kHz to at least the tenth harmonic of the fundamental using a HP model 8566B spectrum analyzer. The measurements were made using the shielded room located at TIMCO ENGINEERING INC. 849 N.W. State Road 45, Newberry, Florida 32669.

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

Out of Band Rejection: Filter frequency response plots

NOTES:

band rejection filter
800MHz /AMPS band

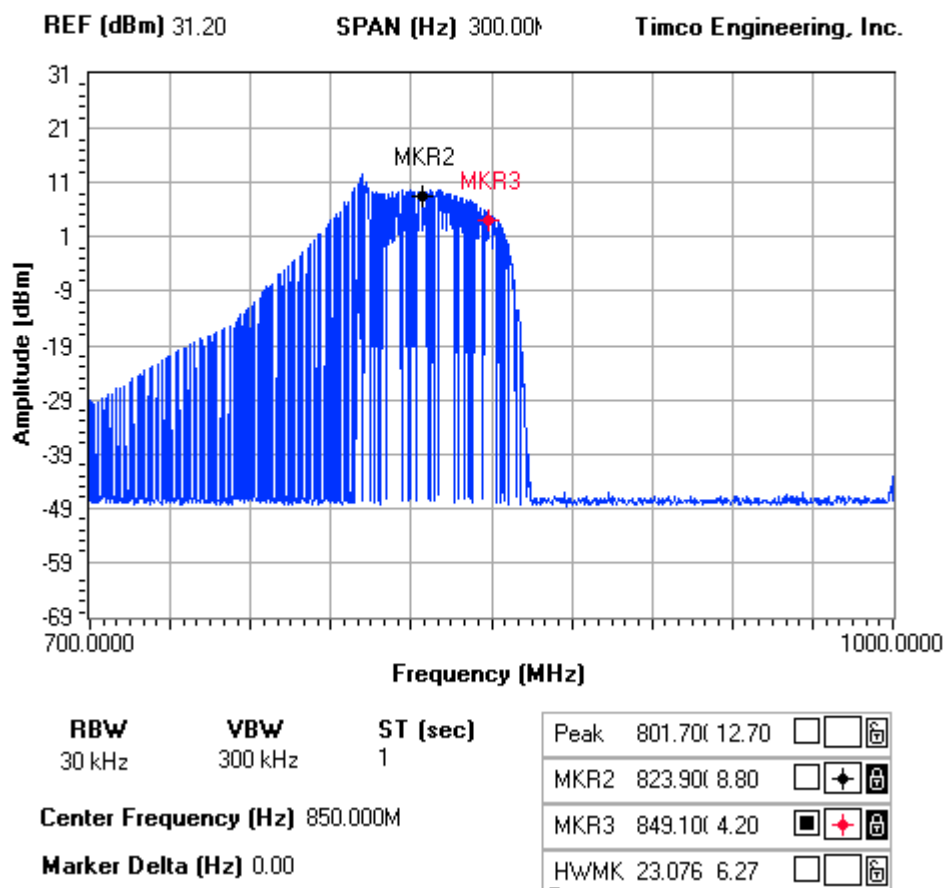


Figure 9. Filer frequency response 850MHz band

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

NOTES:

band rejection filter
PCS band

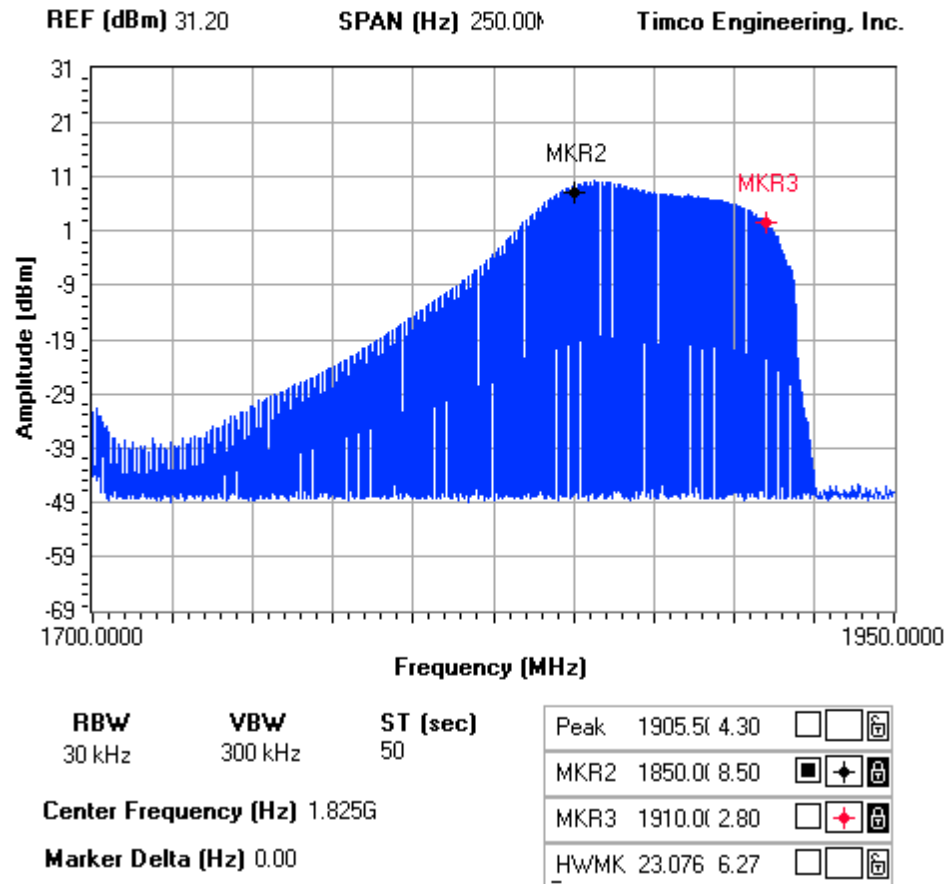


Figure 9. Filer frequency response PCS band

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1053

Field strength of spurious emissions:

REQUIREMENTS: Emissions must be $43 + 10\log(P_o)$ dB below the mean power output of the transmitter: $43 + 10\log(1.514) = 44.8$ dBc (850MHz band) and 44.2 dBc for PCS band. The maximum conducted power was measured at 1.514Watt for 850MHz band and 1.318W for PCS band.

TEST DATA:

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading (dBm)	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
835.35	H	31.00	0	-	-
1670.70	V	-38.20	1.13	5.05	65.28
2506.05	V	-34.20	1.3	6.85	59.65
3341.40	V	-32.90	1.38	7.45	57.83
4176.75	V	-55.30	1.47	7.83	79.94
5012.10	V	-41.90	1.6	7.76	66.74
5847.45	V	-38.80	1.84	8.84	62.8
6682.80	V	-45.30	1.97	8.24	70.03
7518.15	V	-39.70	2	8.7	64
8353.50	V	-49.50	2.17	8.27	74.4

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading (dBm)	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
1880.00	H	29.40	0	0	0
3760.00	H	-38.40	1.43	7.55	61.68
5640.00	V	-23.70	1.76	8.55	46.31
7520.00	V	-32.90	2	8.69	55.61
9400.00	V	-34.80	2.38	9.53	57.05
11280.00	V	-41.20	2.58	8.35	64.83
13160.00	V	-42.00	2.65	9.94	64.11
15040.00	V/H	*	*	*	<64.2
16920.00	V/H	*	*	*	<64.2
18800.00	V/H	*	*	*	<64.2

*NOISE FLOOR

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.


849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

Method of Measuring Radiated Spurious Emissions

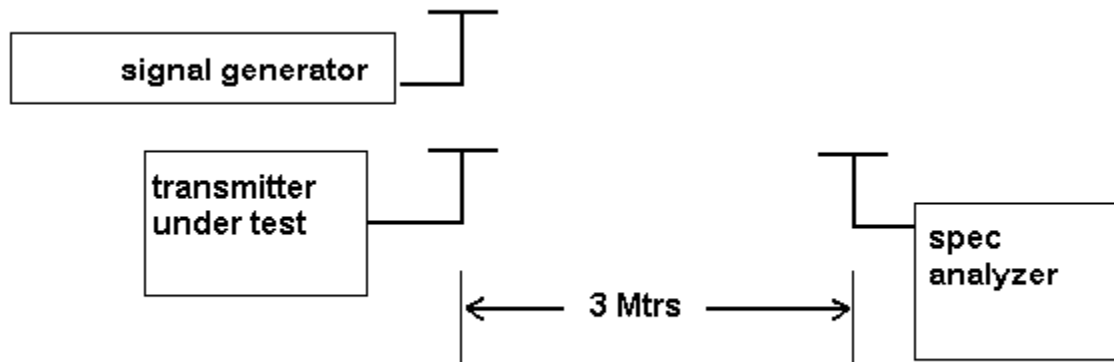

Equipment placed 80 cm above ground
on a rotating table platform.

METHOD OF MEASUREMENTS: The tabulated data shows the results of the radiated field strength emissions test. The spectrum was scanned from 30 MHz to at least the tenth harmonic of the fundamental. The CW signal was used to perform this test. This test was conducted per TIA/EIA STANDARD 603 using the substitution method. Measurements were made at the open field test site of TIMCO ENGINEERING, INC. located at 849 NW State Road 45, Newberry, FL 32669. The worst-case spurious emissions data are reported.

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>888.472.2424 F 352.472.2030 email: sid@timcoengr.com**Equipment List**

	DEVICE	MFGR	MODEL	SERNO	CAL/CHAR DATE	DUE DATE or STATUS
X	3-Meter OATS	TEI	N/A	N/A	Listed 1/13/03	1/13/06
	3/10-Meter OATS	TEI	N/A	N/A	Listed 3/26/01	3/26/04
	Receiver, Beige Tower Spectrum Analyzer	HP	8566B Opt 462	3138A07786 3144A20661	CAL 8/31/01	8/31/03
	RF Preselector	HP	85685A	3221A01400	CAL 8/31/01	8/31/03
	Quasi-Peak Adapter	HP	85650A	3303A01690	CAL 8/31/01	8/31/03
X	Receiver, Blue Tower Spectrum Analyzer	HP	8568B	2928A04729	CAL	4/15/05
X				2848A18049	4/15/03	
X	RF Preselector	HP	85685A	2926A00983	CAL 4/15/03	4/15/05
X	Quasi-Peak Adapter	HP	85650A	2811A01279	CAL 4/15/03	4/15/05
	Receiver, Silver/Grey Tower Spectrum Analyzer	HP	8566B Opt 462	3552A22064 3638A08608	CAL 10/14/02	10/14/04
	RF Preselector	HP	85685A	2620A00294	CAL 10/14/02	10/14/04
	Quasi-Peak Adapter	HP	85650A	3303A01844	CAL 10/14/02	10/14/04
	Preamplifier	HP	8449B	3008A01075	CHAR 1/28/02	1/28/04
X	Biconnical Antenna	Electro-Metrics	BIA-25	1171	CAL 4/26/01	4/26/03
	Biconnical Antenna	Eaton	94455-1	1096	CAL 10/1/01	10/1/03
	Biconnical Antenna	Eaton	94455-1	1057	CAL 3/18/03	3/18/05
	BiconiLog Antenna	EMCO	3143	9409-1043		
X	Log-Periodic Antenna	Electro-Metrics	LPA-25	1122	CAL 10/2/01	10/2/03
	Log-Periodic Antenna	Electro-Metrics	EM-6950	632	CHAR 10/15/01	10/15/03
	Log-Periodic Antenna	Electro-Metrics	LPA-30	409	CAL 3/4/03	3/4/05
	Dipole Antenna Kit	Electro-Metrics	TDA-30/1-4	152	CAL 3/21/01	3/21/04

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>888.472.2424 F 352.472.2030 email: sid@timcoengr.com

	DEVICE	MFGR	MODEL	SERNO	CAL/CHAR DATE	DUE DATE or STATUS
	Dipole Antenna Kit	Electro-Metrics	TDA-30/1-4	153	CAL 9/26/02	9/26/05
	Double-Ridged Horn Antenna	Electro-Metrics	RGA-180	2319	CAL 2/17/03	2/17/05
	Horn Antenna	Electro-Metrics	EM-6961	6246	CAL 3/31/03	3/31/05
	Horn Antenna	ATM	19-443-6R	None	No Cal Required	
	Passive Loop Antenna	EMC Test Systems	EMCO 6512	9706-1211	CHAR 7/10/01	7/10/03
	Line Impedance Stabilization . . .	Electro-Metrics	ANS-25/2	2604	CAL 10/9/01	10/9/03
	Line Impedance Stabilization . . .	Electro-Metrics	EM-7820	2682	CAL 3/12/03	3/12/05
	Termaline Wattmeter	Bird Electronic Corporation	611	16405	CAL 5/25/99	5/25/01
	Termaline Wattmeter	Bird Electronic Corporation	6104	1926	CHAR 12/12/01	12/12/03
	Oscilloscope	Tektronix	2230	300572	CHAR 2/1/01	2/1/03
	System One	Audio Precision	System One	SYS1-45868	CHAR 4/25/02	4/25/04
	Temperature Chamber	Tenney Engineering	TTRC	11717-7	CHAR 1/22/02	1/22/04
	AC Voltmeter	HP	400FL	2213A14499	CAL 10/9/01	10/9/03
	AC Voltmeter	HP	400FL	2213A14261	CHAR 10/15/01	10/15/03
	AC Voltmeter	HP	400FL	2213A14728	CHAR 10/15/01	10/15/03
X	Digital Multimeter	Fluke	77	35053830	CHAR 1/8/02	1/8/04
	Digital Multimeter	Fluke	77	43850817	CHAR 1/8/02	1/8/04
	Digital Multimeter	HP	E2377A	2927J05849	CHAR 1/8/02	1/8/04
	Multimeter	Fluke	FLUKE-77-3	79510405	CHAR 9/26/01	9/26/03
	Peak Power Meter	HP	8900C	2131A00545	CHAR 1/26/01	1/26/03
	Power Meter	HP	432A	1141A07655	CAL 4/15/03	4/15/05
	Power Meter And Sensor	Bird	4421-107 4022	0166 0218	CAL 4/16/03	4/16/05
	Power Sensor	HP	478A	72129	CAL 4/15/03	4/15/05

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>888.472.2424 F 352.472.2030 email: sid@timcoengr.com

	DEVICE	MFGR	MODEL	SERNO	CAL/CHAR DATE	DUE DATE or STATUS
	Digital Thermometer	Fluke	2166A	42032	CAL 1/16/02	1/16/04
	Thermometer	Traulsen	SK-128		CHAR 1/22/02	1/22/04
	Thermometer	Extech	4028	14871-2	CAL 3/7/03	3/7/05
X	Hygro-Thermometer	Extech	445703	0602	CAL 10/4/02	10/4/04
	Frequency Counter	HP	5352B	2632A00165	CAL 11/28/01	11/28/03
	Frequency Counter	HP	5385A	2730A03025	CAL 3/7/03	3/7/05
	Power Sensor	Agilent Technologies	84811A	2551A02705	CHAR 1/26/01	1/26/03
	Service Monitor	IFR	FM/AM 500A	5182	CAL 11/22/00	11/22/02
	Comm. Serv. Monitor	IFR	FM/AM 1200S	6593	CAL 5/12/02	5/12/04
	Signal Generator	HP	8640B	2308A21464	CAL 2/15/02	2/15/04
	Sweep Generator	Wiltron	6648	101009	CAL 4/15/03	4/15/05
	Sweep Generator	Wiltron	6669M	007005	CAL 3/3/03	3/3/05
	Modulation Analyzer	HP	8901A	3435A06868	CAL 9/5/01	9/5/03
	Modulation Meter	Boonton	8220	10901AB	CAL 4/15/03	4/15/05
	Near Field Probe	HP	HP11940A	2650A02748	CHAR 2/1/01	2/1/03
	BandReject Filter	Lorch Microwave	5BR4-2400/ 60-N	Z1	CHAR 3/2/01	3/2/03
	BandReject Filter	Lorch Microwave	6BR6-2442/ 300-N	Z1	CHAR 3/2/01	3/2/03
	BandReject Filter	Lorch Microwave	5BR4-10525/ 900-S	Z1	CHAR 3/2/01	3/2/03
	High Pass Filter	Microlab	HA-10N		CHAR 10/4/01	10/4/03
	High Pass Filter	Microlab	HA-20N		CHAR 2/7/03	2/7/05
	Audio Oscillator	HP	653A	832-00260	CHAR 3/1/01	3/1/03
	Frequency Counter	HP	5382A	1620A03535	CHAR 3/2/01	3/2/03
	Frequency Counter	HP	5385A	3242A07460	CAL 3/7/03	3/7/05

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>888.472.2424 F 352.472.2030 email: sid@timcoengr.com

	DEVICE	MFGR	MODEL	SERNO	CAL/CHAR DATE	DUE DATE or STATUS
	Preamplifier	HP	8449B-H02	3008A00372	CHAR 3/4/01	3/4/03
	Amplifier	HP	11975A	2738A01969	CHAR 3/1/01	3/1/03
	Egg Timer	Unk			CHAR 8/31/01	8/31/03
	Measuring Tape, 20M	Kraftixx	0631-20		CHAR 2/1/02	2/1/04
	Measuring Tape, 7.5M	Kraftixx	7.5M PROFI		2/1/02	2/1/04
	Coaxial Cable #51	Insulated Wire Inc.	NPS 2251-2880	Timco #51	CHAR 1/23/02	1/23/04
	Coaxial Cable #64	Semflex Inc.	60637	Timco #64	CHAR 1/24/02	1/24/04
	Coaxial Cable #65	General Cable Co.	E9917 RG233/U	Timco #65	CHAR 1/23/02	1/23/04
	Coaxial Cable #106	Unknown	Unknown	Timco #106	CHAR 1/23/02	1/23/04

APPLICANT: DIGITAL ANTENNA

FCC ID: RFJCB-127

REPORT #: D/DigitalAntenna_PZO\186AUT3\186AUT3TestReport.doc

TABLE OF CONTENTS