




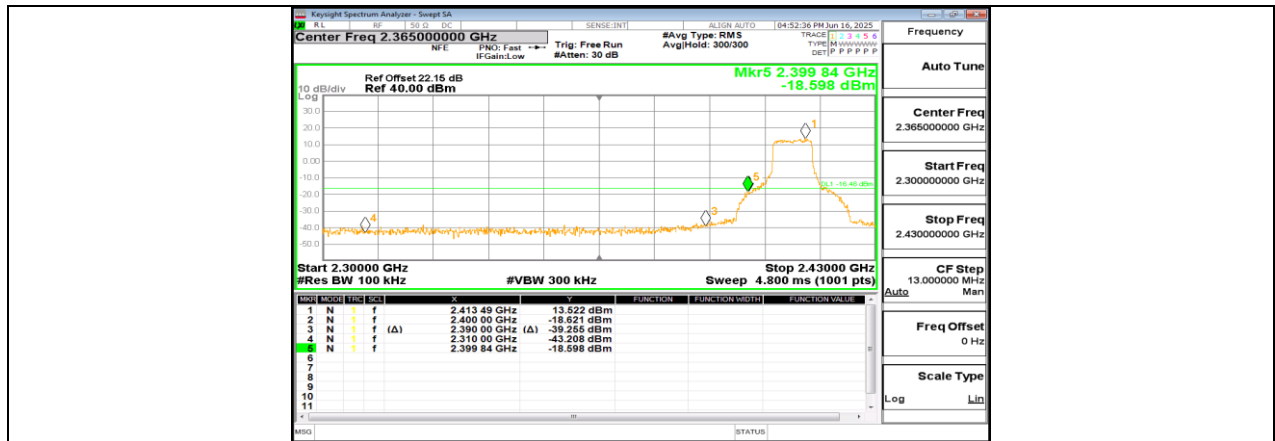

SRD 10M Ant1 Low 2410.5

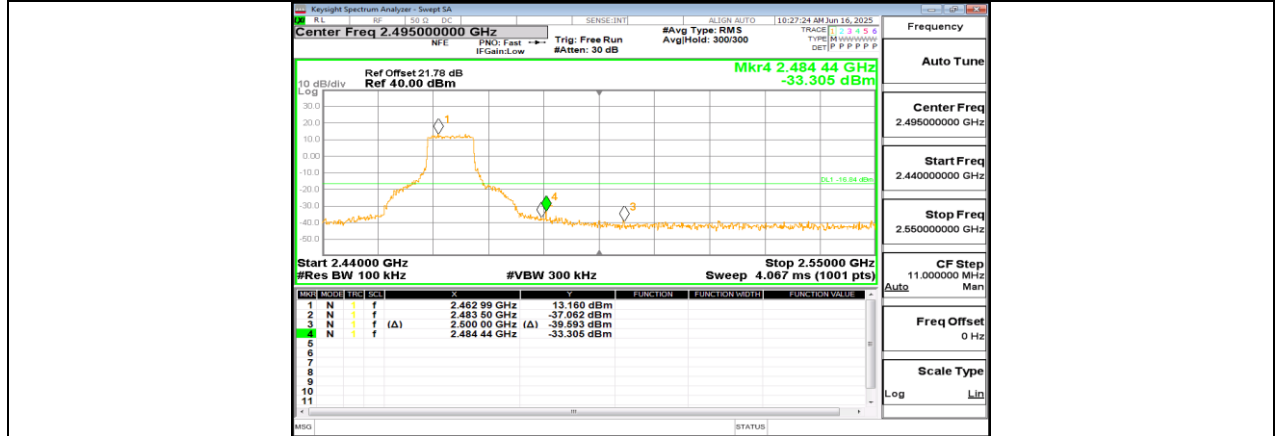


SRD 10M Ant0 High 2465.5

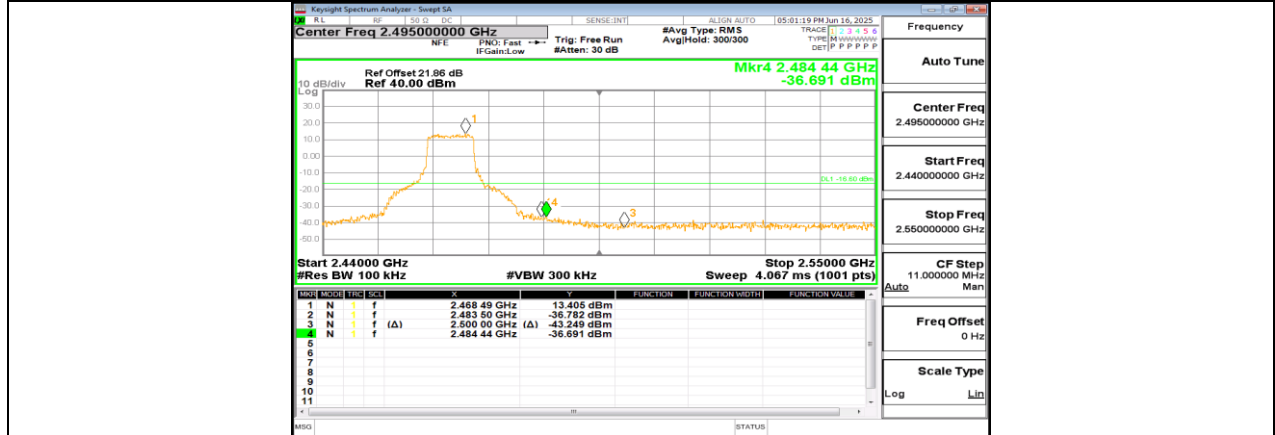

SRD 10M Ant1 High 2465.5



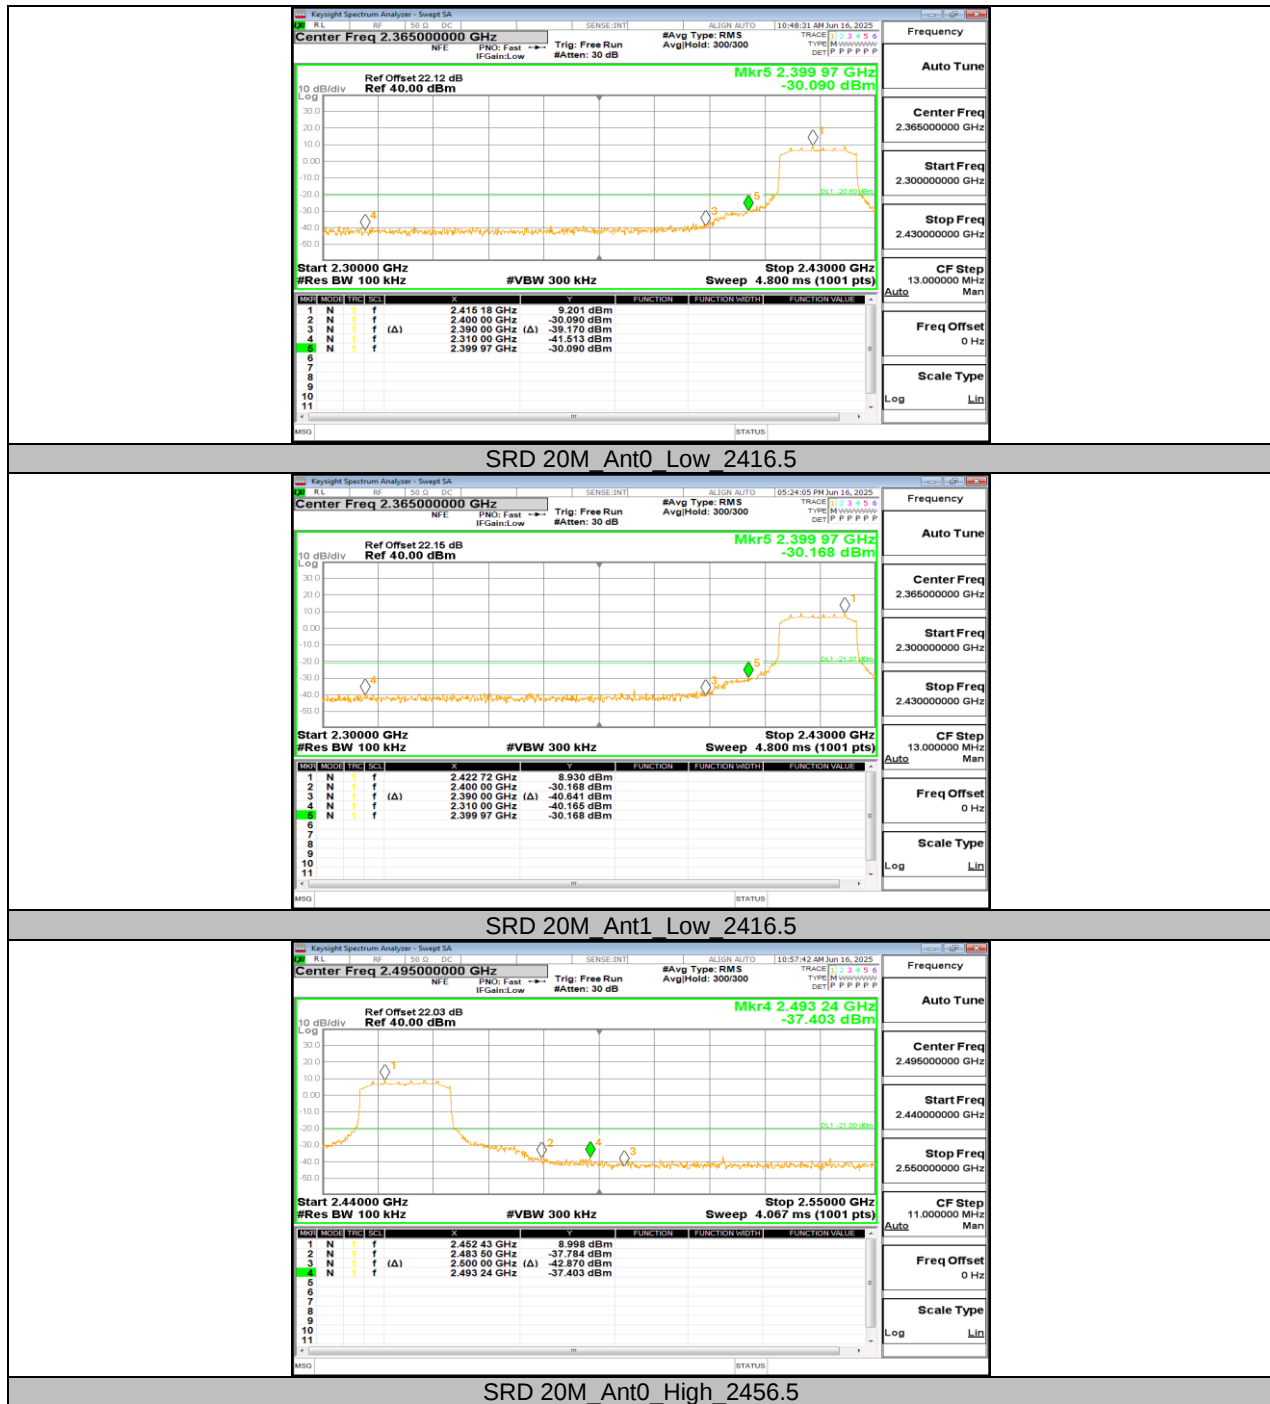












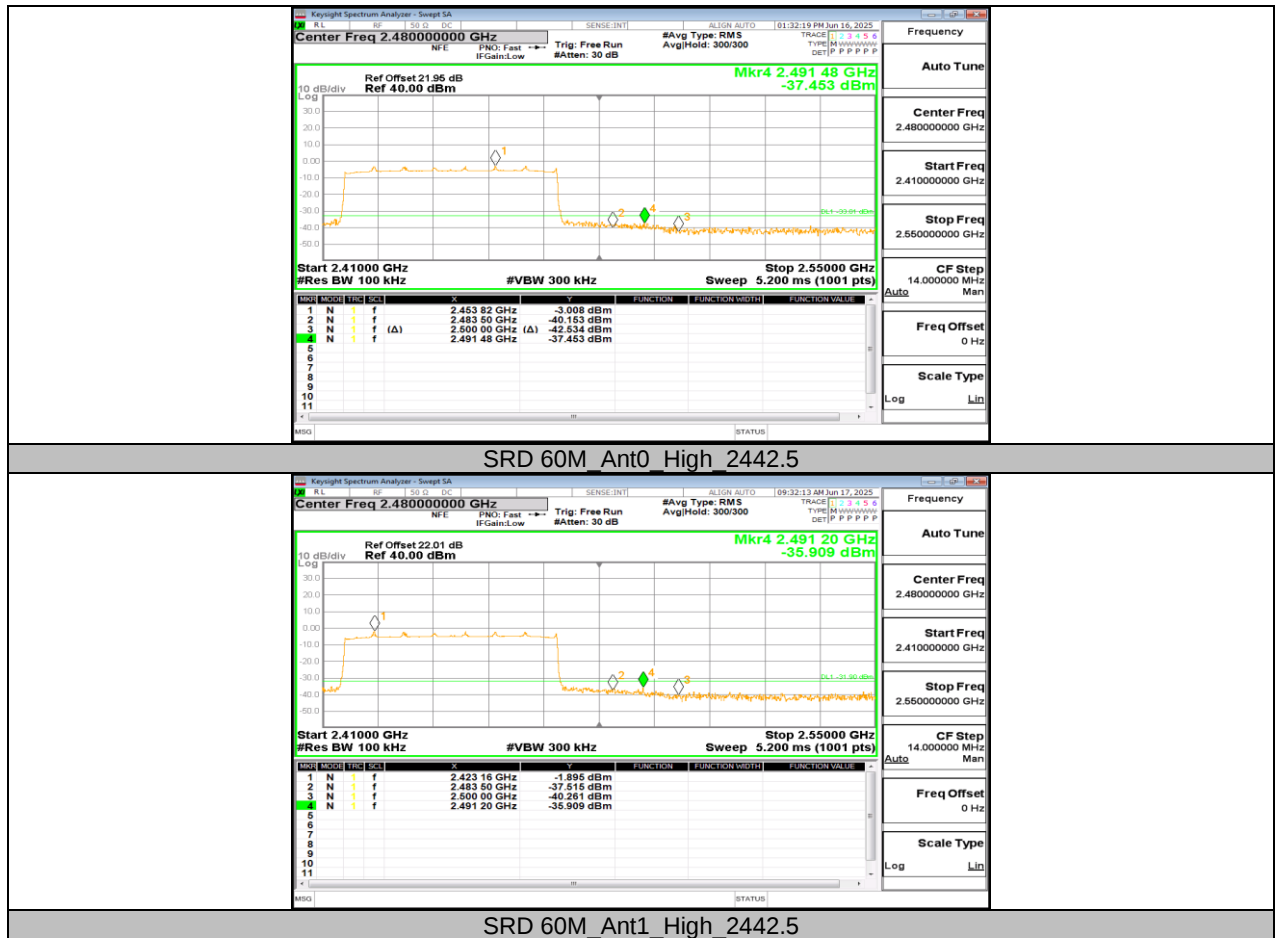

11.6. APPENDIX F: CONDUCTED SPURIOUS EMISSION

11.6.1. Test Result

Test Mode	Antenna	Frequency[MHz]	FreqRange [Mhz]	Result [dBm]	Limit [dBm]	Verdict
SRD 10M	Ant0	2407.5	Reference	10.41	---	PASS
			30~1000	-50.82	≤-19.59	PASS
			1000~26500	-41.16	≤-19.59	PASS
	Ant1	2407.5	Reference	11.69	---	PASS
			30~1000	-51.19	≤-18.31	PASS
			1000~26500	-41.48	≤-18.31	PASS
	Ant0	2410.5	Reference	11.76	---	PASS
			30~1000	-50.37	≤-18.24	PASS
			1000~26500	-41.38	≤-18.24	PASS
	Ant1	2410.5	Reference	12.11	---	PASS
			30~1000	-50.81	≤-17.89	PASS
			1000~26500	-41.31	≤-17.89	PASS
	Ant0	2437.5	Reference	12.48	---	PASS
			30~1000	-51.38	≤-17.52	PASS
			1000~26500	-42.3	≤-17.52	PASS
	Ant1	2437.5	Reference	14.46	---	PASS
			30~1000	-51.39	≤-15.54	PASS
			1000~26500	-40.52	≤-15.54	PASS
	Ant0	2465.5	Reference	11.93	---	PASS
			30~1000	-51.08	≤-18.07	PASS
			1000~26500	-41.42	≤-18.07	PASS
	Ant1	2465.5	Reference	12.24	---	PASS
			30~1000	-51.22	≤-17.76	PASS
			1000~26500	-41.42	≤-17.76	PASS
	Ant0	2467.5	Reference	16.68	---	PASS
			30~1000	-49.75	≤-13.32	PASS
			1000~26500	-40.81	≤-13.32	PASS
	Ant1	2467.5	Reference	10.30	---	PASS
			30~1000	-49.52	≤-19.7	PASS
			1000~26500	-41.52	≤-19.7	PASS
SRD 20M	Ant0	2412.5	Reference	3.07	---	PASS
			30~1000	-51.16	≤-26.93	PASS
			1000~26500	-40.18	≤-26.93	PASS
	Ant1	2412.5	Reference	2.56	---	PASS
			30~1000	-51.33	≤-27.44	PASS
			1000~26500	-41.37	≤-27.44	PASS
	Ant0	2416.5	Reference	6.74	---	PASS
			30~1000	-50.32	≤-23.26	PASS
			1000~26500	-42.02	≤-23.26	PASS
	Ant1	2416.5	Reference	6.47	---	PASS
			30~1000	-49.43	≤-23.53	PASS
			1000~26500	-41.47	≤-23.53	PASS
	Ant0	2437.5	Reference	9.40	---	PASS
			30~1000	-51.22	≤-20.6	PASS
			1000~26500	-41.62	≤-20.6	PASS
	Ant1	2437.5	Reference	9.14	---	PASS
			30~1000	-51.22	≤-20.86	PASS
			1000~26500	-41.41	≤-20.86	PASS
	Ant0	2456.5	Reference	8.50	---	PASS
			30~1000	-51.22	≤-21.5	PASS
			1000~26500	-40.59	≤-21.5	PASS
	Ant1	2456.5	Reference	7.78	---	PASS
			30~1000	-50.66	≤-22.22	PASS
			1000~26500	-41.57	≤-22.22	PASS
	Ant0	2458.5	Reference	6.13	---	PASS

	Ant1	2458.5	30~1000	-50.35	≤ -23.87	PASS
			1000~26500	-42.02	≤ -23.87	PASS
			Reference	4.13	---	PASS
			30~1000	-50.4	≤ -25.87	PASS
			1000~26500	-40.54	≤ -25.87	PASS
			Reference	1.10	---	PASS
	Ant0	2462.5	30~1000	-51.15	≤ -28.9	PASS
			1000~26500	-41.21	≤ -28.9	PASS
			Reference	1.05	---	PASS
			30~1000	-50.45	≤ -28.95	PASS
			1000~26500	-41.58	≤ -28.95	PASS
			Reference	-2.61	---	PASS
SRD 40M	Ant0	2422.5	30~1000	-50.58	≤ -32.61	PASS
			1000~26500	-41.71	≤ -32.61	PASS
			Reference	-1.51	---	PASS
	Ant1	2422.5	30~1000	-51.17	≤ -31.51	PASS
			1000~26500	-41.38	≤ -31.51	PASS
			Reference	3.28	---	PASS
	Ant0	2426.5	30~1000	-50.38	≤ -26.72	PASS
			1000~26500	-40.93	≤ -26.72	PASS
			Reference	1.50	---	PASS
	Ant1	2426.5	30~1000	-50.65	≤ -28.5	PASS
			1000~26500	-40.81	≤ -28.5	PASS
			Reference	4.03	---	PASS
	Ant0	2437.5	30~1000	-50.59	≤ -25.97	PASS
			1000~26500	-42.05	≤ -25.97	PASS
			Reference	5.80	---	PASS
	Ant1	2437.5	30~1000	-50.89	≤ -24.2	PASS
			1000~26500	-41.36	≤ -24.2	PASS
			Reference	2.94	---	PASS
	Ant0	2447.5	30~1000	-49.69	≤ -27.06	PASS
			1000~26500	-41.09	≤ -27.06	PASS
			Reference	4.42	---	PASS
	Ant1	2447.5	30~1000	-51.63	≤ -25.58	PASS
			1000~26500	-41.09	≤ -25.58	PASS
			Reference	-2.90	---	PASS
	Ant0	2452.5	30~1000	-51.05	≤ -32.9	PASS
			1000~26500	-40.6	≤ -32.9	PASS
			Reference	-1.17	---	PASS
	Ant1	2452.5	30~1000	-50.96	≤ -31.17	PASS
			1000~26500	-40.7	≤ -31.17	PASS
			Reference	-2.75	---	PASS
SRD 60M	Ant0	2432.5	30~1000	-50.63	≤ -32.75	PASS
			1000~26500	-41.76	≤ -32.75	PASS
			Reference	-5.91	---	PASS
	Ant1	2432.5	30~1000	-50.85	≤ -35.91	PASS
			1000~26500	-41.75	≤ -35.91	PASS
			Reference	-4.60	---	PASS
	Ant0	2437.5	30~1000	-51.24	≤ -34.6	PASS
			1000~26500	-41.12	≤ -34.6	PASS
			Reference	-1.68	---	PASS
	Ant1	2437.5	30~1000	-51.65	≤ -31.68	PASS
			1000~26500	-41.59	≤ -31.68	PASS
			Reference	-3.97	---	PASS
	Ant0	2442.5	30~1000	-50.81	≤ -33.97	PASS
			1000~26500	-41.9	≤ -33.97	PASS
			Reference	-3.47	---	PASS
	Ant1	2442.5	30~1000	-50.85	≤ -33.47	PASS
			1000~26500	-40.67	≤ -33.47	PASS
			Reference	-3.47	---	PASS

11.6.2. Test Graphs

