
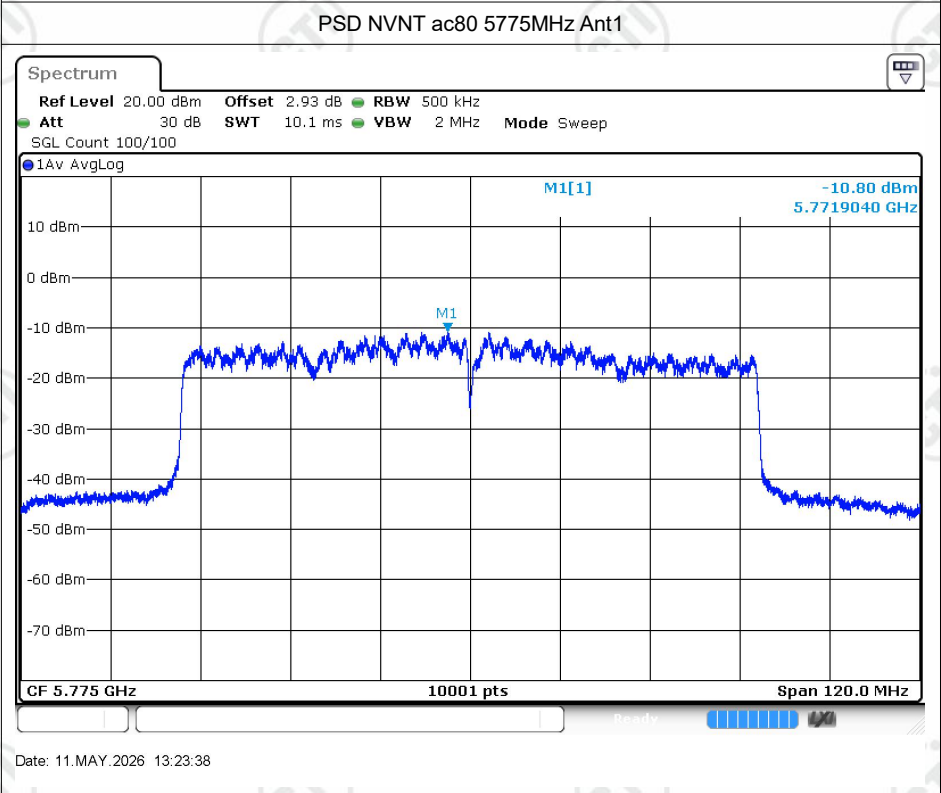


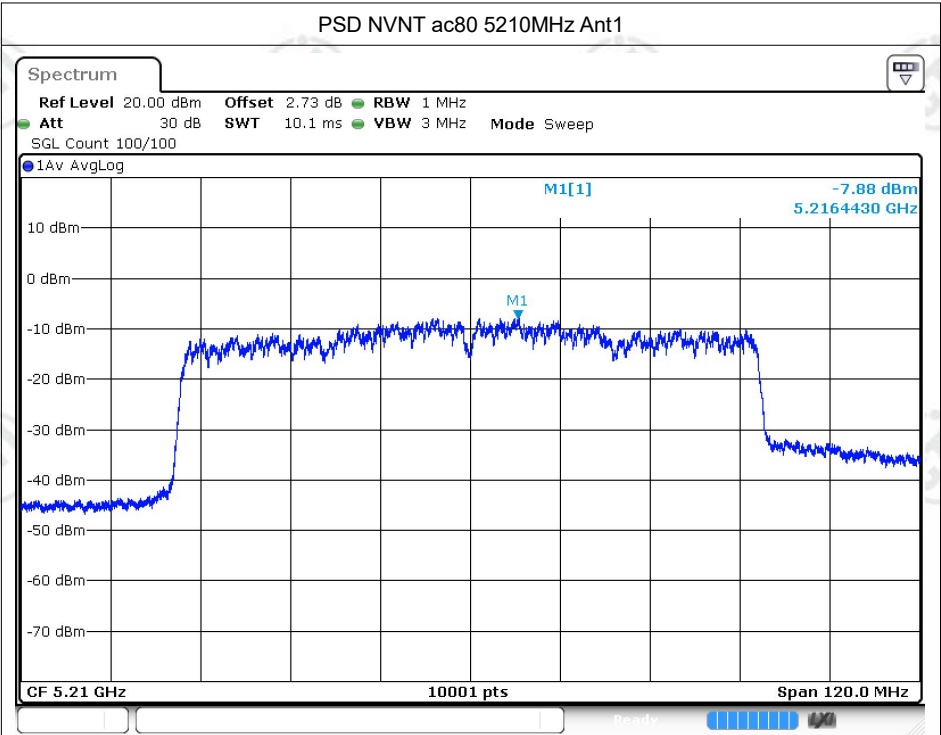

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 138V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 136V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-10C 136V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
0C 136V	a	5180	Ant1	5179.96	-40000	-7.72	25	Pass
10C 136V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 136V	a	5180	Ant1	5179.96	-40000	-7.72	25	Pass
30C 136V	a	5180	Ant1	5179.96	-40000	-7.72	25	Pass
40C 136V	a	5180	Ant1	5179.94	-60000	-11.58	25	Pass
50C 136V	a	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 102V	a	5200	Ant1	5199.94	-60000	-11.54	25	Pass
20C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 138V	a	5200	Ant1	5199.94	-60000	-11.54	25	Pass
-20C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
-10C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
0C 120V	a	5200	Ant1	5199.94	-60000	-11.54	25	Pass
10C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
30C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
40C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
50C 120V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 102V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 138V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-20C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 120V	a	5240	Ant1	5239.92	-80000	-15.27	25	Pass
30C 120V	a	5240	Ant1	5239.94	-60000	-11.45	25	Pass
40C 120V	a	5240	Ant1	5239.94	-60000	-11.45	25	Pass
50C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 102V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 138V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
-20C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
-10C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
0C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass

10C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
30C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
40C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
50C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 102V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 138V	a	5785	Ant1	5784.94	-60000	-10.37	25	Pass
-20C 120V	a	5785	Ant1	5784.92	-80000	-13.83	25	Pass
-10C 120V	a	5785	Ant1	5784.92	-80000	-13.83	25	Pass
0C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
10C 120V	a	5785	Ant1	5784.94	-60000	-10.37	25	Pass
30C 120V	a	5785	Ant1	5784.94	-60000	-10.37	25	Pass
40C 120V	a	5785	Ant1	5784.94	-60000	-10.37	25	Pass
50C 120V	a	5785	Ant1	5784.94	-60000	-10.37	25	Pass
20C 102V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 120V	a	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 138V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-20C 120V	a	5825	Ant1	5824.94	-60000	-10.3	25	Pass
-10C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
0C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
10C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
30C 120V	a	5825	Ant1	5824.94	-60000	-10.3	25	Pass
40C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
50C 120V	a	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 102V	n20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 138V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
-20C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
-10C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
0C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
10C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
40C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
50C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 102V	n20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 120V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 138V	n20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
-20C 120V	n20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
-10C 120V	n20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
0C 120V	n20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
10C 120V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
30C 120V	n20	5200	Ant1	5199.94	-60000	-11.54	25	Pass

40C 120V	n20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
50C 120V	n20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
20C 102V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 138V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
-20C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
0C 120V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
10C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
30C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
40C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
50C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 102V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 120V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 138V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
-20C 120V	n20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-10C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
0C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
10C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
30C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
40C 120V	n20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
50C 120V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 102V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 120V	n20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
20C 138V	n20	5785	Ant1	5784.92	-80000	-13.83	25	Pass
-20C 120V	n20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
-10C 120V	n20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
0C 120V	n20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
10C 120V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
30C 120V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
40C 120V	n20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
50C 120V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 102V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 120V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 138V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
-10C 120V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
0C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	n20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
30C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
50C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass

20C 102V	n40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
20C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 138V	n40	5190	Ant1	5190	0	0	25	Pass
-20C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-10C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
0C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
10C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
30C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
40C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
50C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 102V	n40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
20C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 138V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-20C 120V	n40	5230	Ant1	5230	0	0	25	Pass
-10C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
0C 120V	n40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
10C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
30C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
40C 120V	n40	5230	Ant1	5230	0	0	25	Pass
50C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 102V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 138V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-20C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
10C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
30C 120V	n40	5755	Ant1	5754.88	-120000	-20.85	25	Pass
40C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 102V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 138V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-20C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-10C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
0C 120V	n40	5795	Ant1	5795	0	0	25	Pass
10C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
30C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
40C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
50C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 102V	ac20	5180	Ant1	5180	0	0	25	Pass
20C 120V	ac20	5180	Ant1	5179.96	-40000	-7.72	25	Pass


20C 138V	ac20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
-20C 120V	ac20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
-10C 120V	ac20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
0C 120V	ac20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
10C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 120V	ac20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
40C 120V	ac20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
50C 120V	ac20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 102V	ac20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 120V	ac20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
20C 138V	ac20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
-20C 120V	ac20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
-10C 120V	ac20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
0C 120V	ac20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
10C 120V	ac20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
30C 120V	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 120V	ac20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
50C 120V	ac20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 102V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 138V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-20C 120V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
-10C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
10C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
30C 120V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
40C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
50C 120V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 102V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 120V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 138V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
-20C 120V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
-10C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
0C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
10C 120V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
30C 120V	ac20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
40C 120V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
50C 120V	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 102V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
20C 120V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
20C 138V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
-20C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass

-10C 120V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
0C 120V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
10C 120V	ac20	5785	Ant1	5784.94	-60000	-10.37	25	Pass
30C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
40C 120V	ac20	5785	Ant1	5784.92	-80000	-13.83	25	Pass
50C 120V	ac20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 102V	ac20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 138V	ac20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
-20C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-10C 120V	ac20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
0C 120V	ac20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
10C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
30C 120V	ac20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
40C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
50C 120V	ac20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 102V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 138V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-20C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
-10C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
0C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
10C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
30C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
40C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
50C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
20C 102V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 138V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-20C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-10C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
0C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
10C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
30C 120V	ac40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
40C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
50C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 102V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 138V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
-20C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
0C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass


10C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
30C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
40C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
50C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 102V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 138V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-20C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-10C 120V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
0C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
10C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
30C 120V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
40C 120V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
50C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 102V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 138V	ac80	5210	Ant1	5210	0	0	25	Pass
-20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
-10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
0C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
30C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
40C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
50C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 102V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 138V	ac80	5775	Ant1	5775	0	0	25	Pass
-20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
-10C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
0C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
10C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
30C 120V	ac80	5775	Ant1	5774.84	-160000	-27.71	25	Pass
40C 120V	ac80	5775	Ant1	5774.84	-160000	-27.71	25	Pass
50C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass

-6dB Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	-6 dB Bandwidth (MHz)	Limit -6 dB Bandwidth (MHz)	Verdict
NVNT	a	5745	Ant1	16.302	0.5	Pass
NVNT	a	5785	Ant1	16.293	0.5	Pass
NVNT	a	5825	Ant1	16.275	0.5	Pass
NVNT	n20	5745	Ant1	17.277	0.5	Pass
NVNT	n20	5785	Ant1	17.133	0.5	Pass
NVNT	n20	5825	Ant1	17.034	0.5	Pass
NVNT	n40	5755	Ant1	35.436	0.5	Pass
NVNT	n40	5795	Ant1	35.724	0.5	Pass
NVNT	ac20	5745	Ant1	17.526	0.5	Pass
NVNT	ac20	5785	Ant1	17.523	0.5	Pass
NVNT	ac20	5825	Ant1	16.887	0.5	Pass
NVNT	ac40	5755	Ant1	35.442	0.5	Pass
NVNT	ac40	5795	Ant1	35.88	0.5	Pass
NVNT	ac80	5775	Ant1	75.336	0.5	Pass

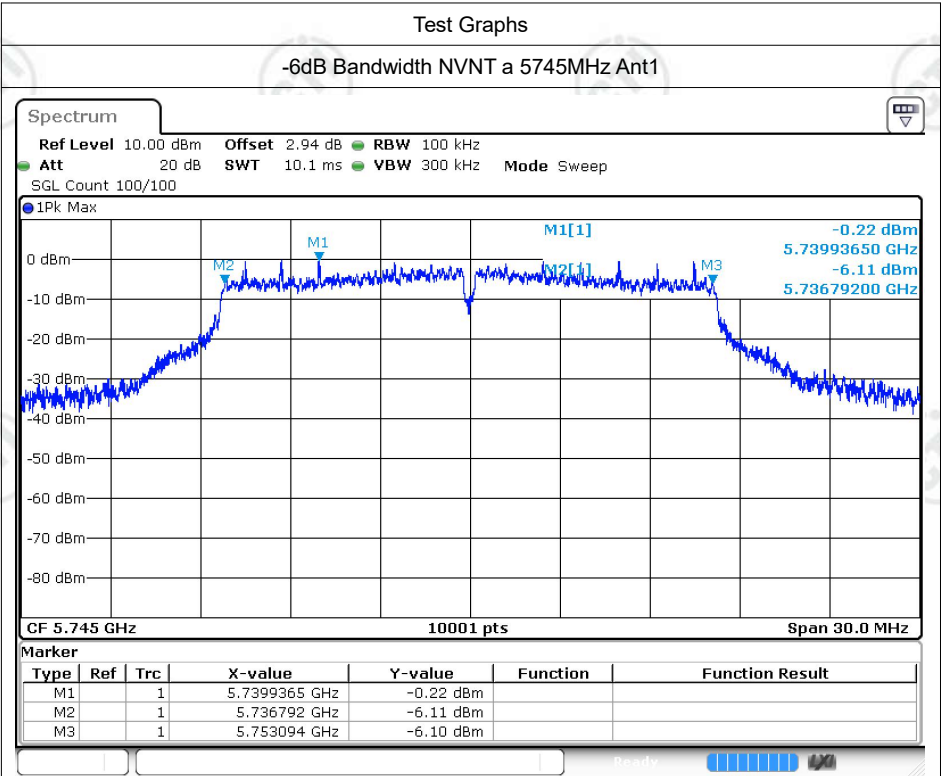


Date: 11.MAY.2026 12:40:41

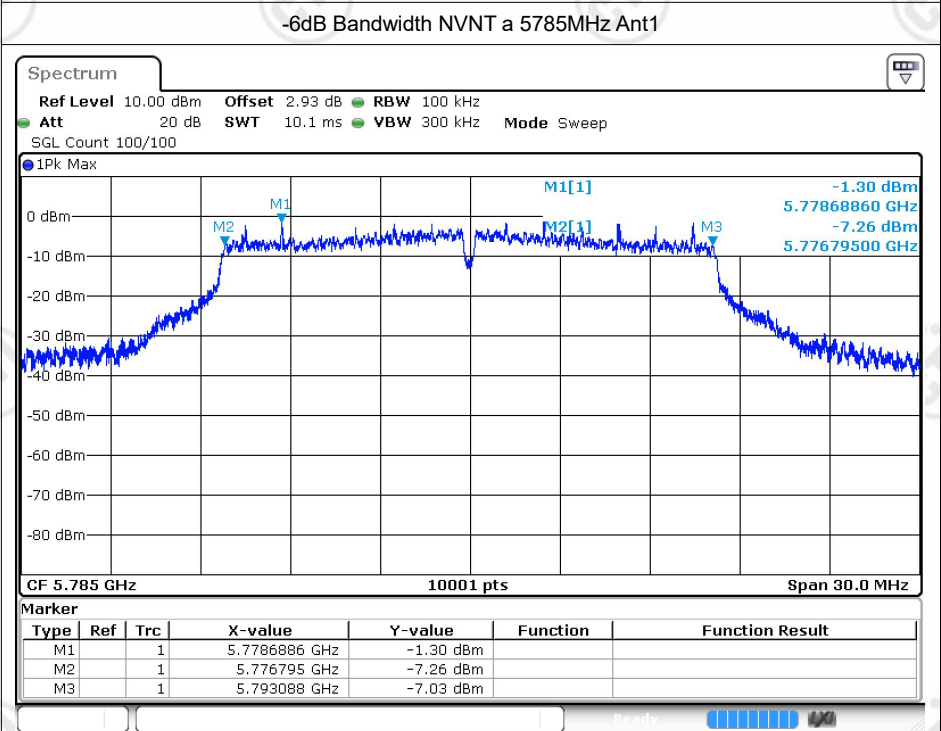


Date: 11.MAY.2026 12:42:03

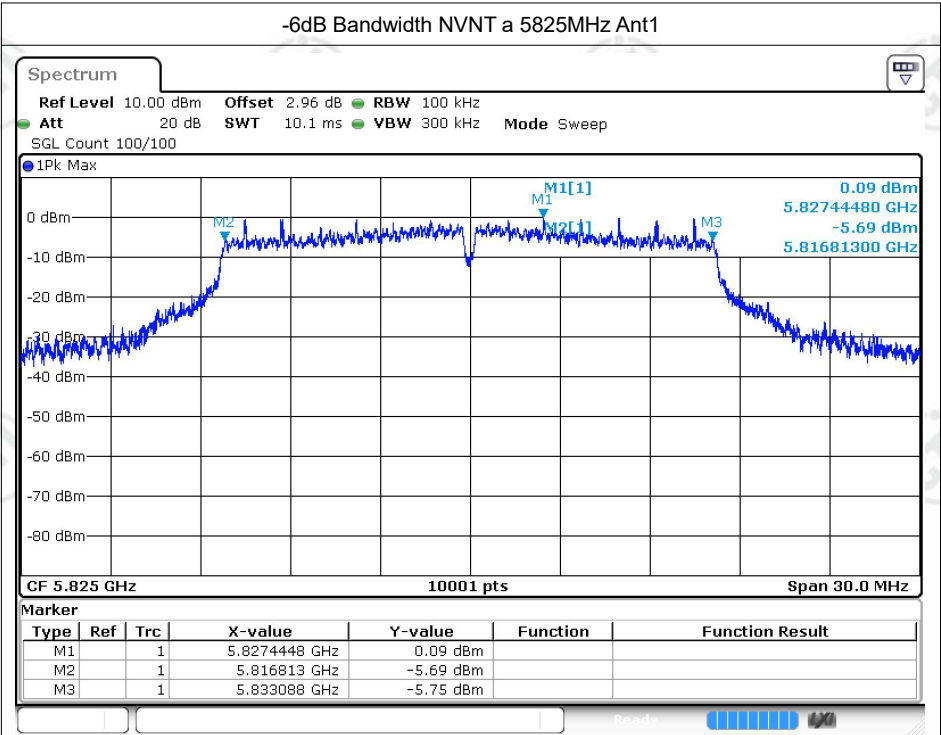


Date: 11.MAY.2026 12:52:28

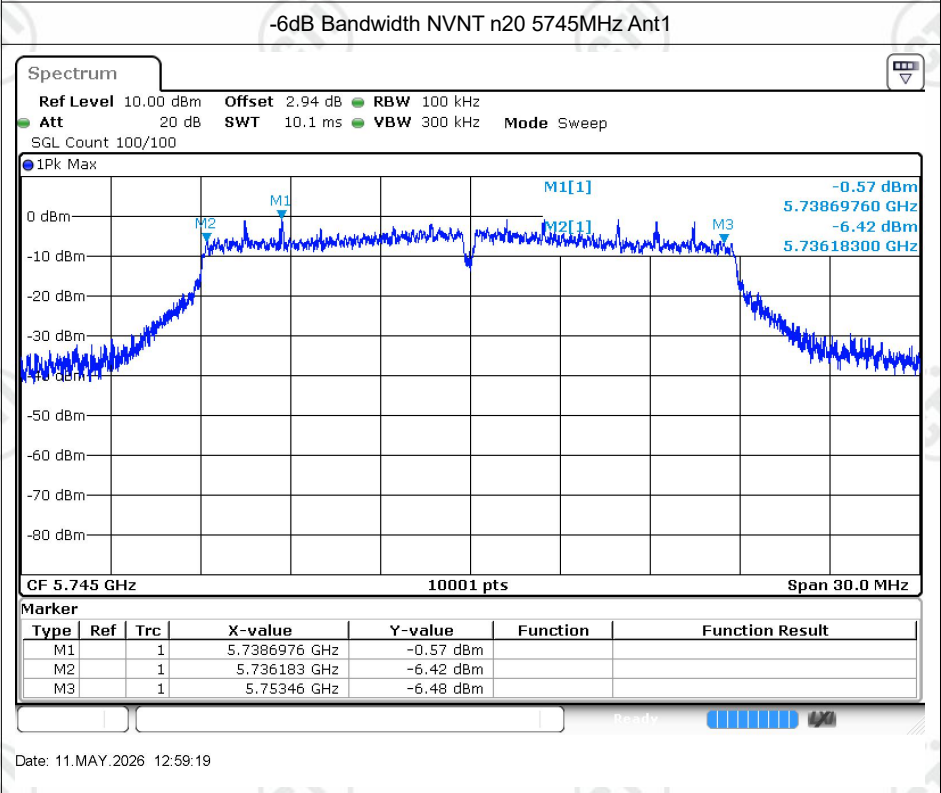


Date: 11.MAY.2026 12:59:19

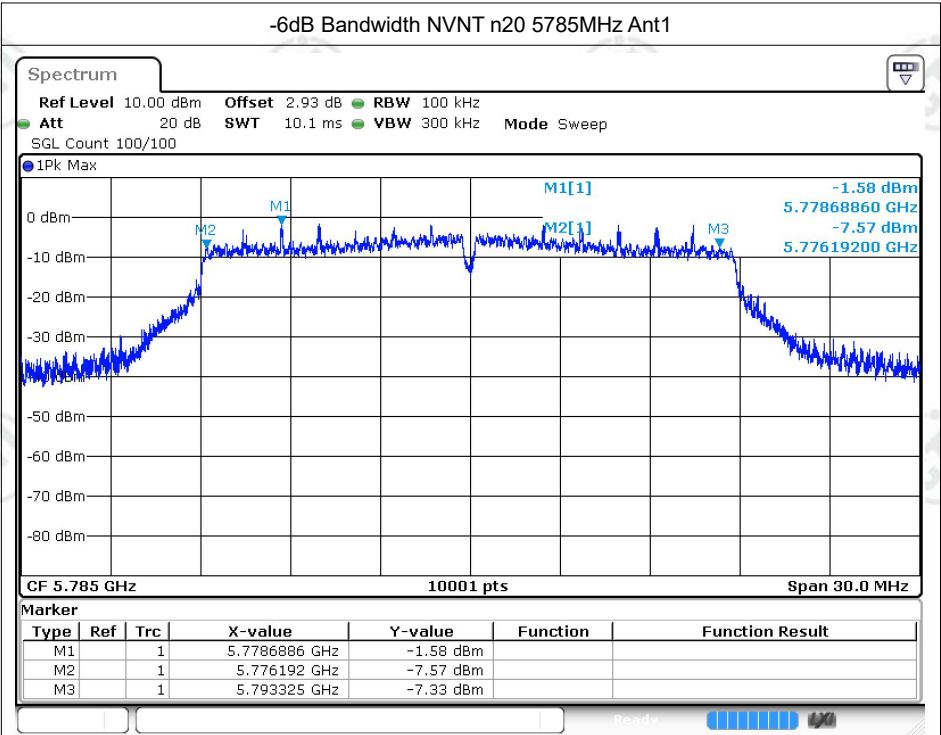


Date: 11.MAY.2026 13:01:36

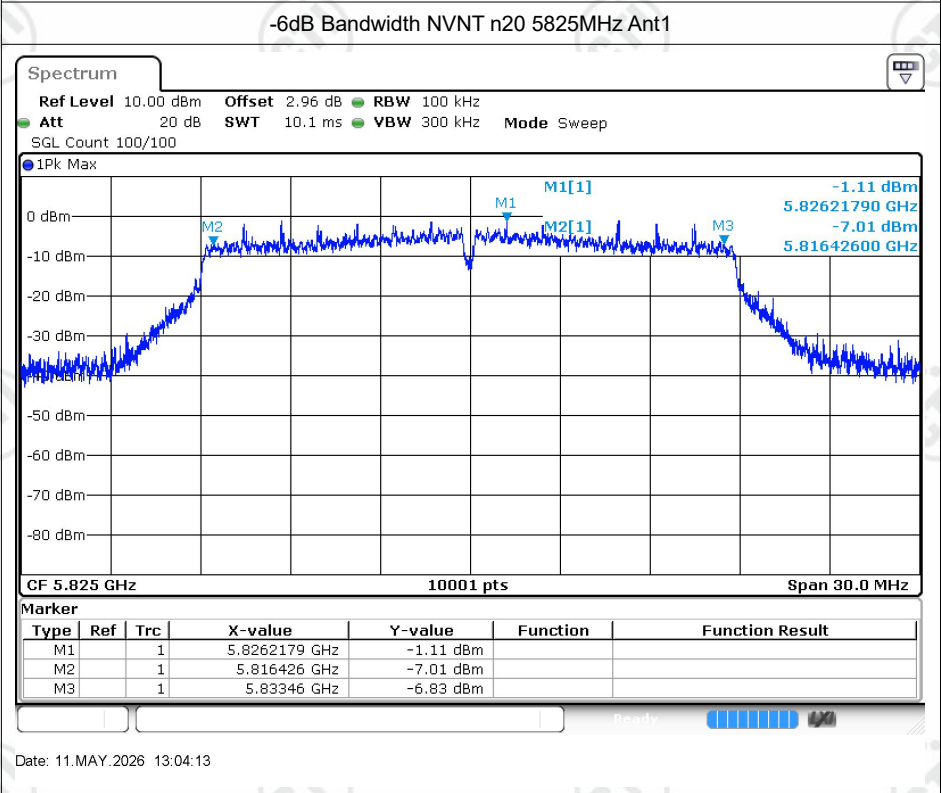


Date: 11.MAY.2026 13:04:13

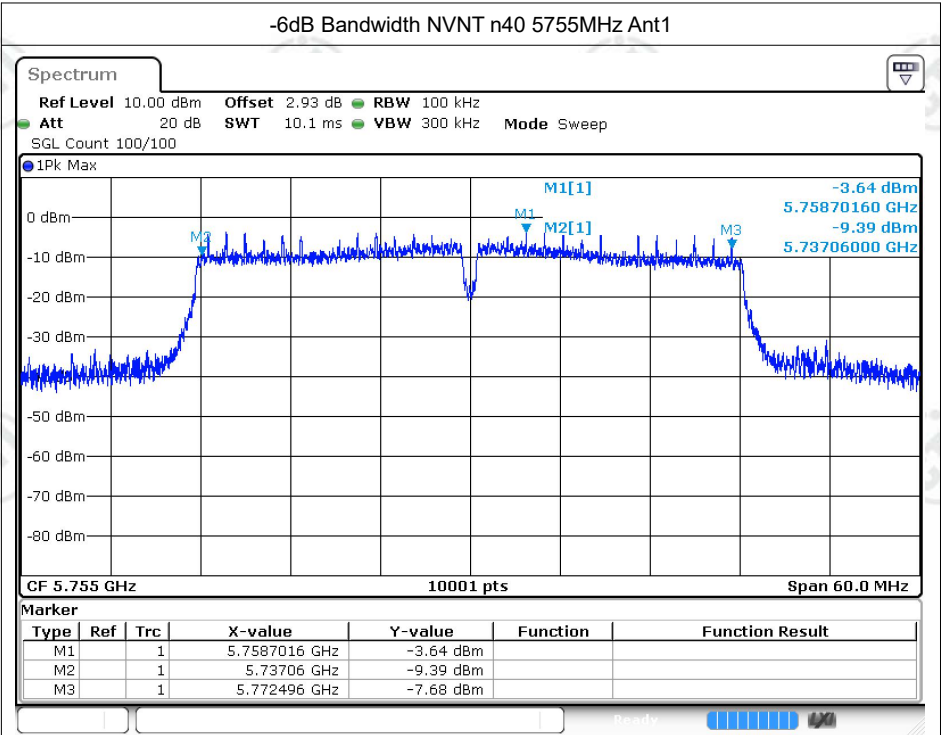


Date: 11.MAY.2026 13:09:42

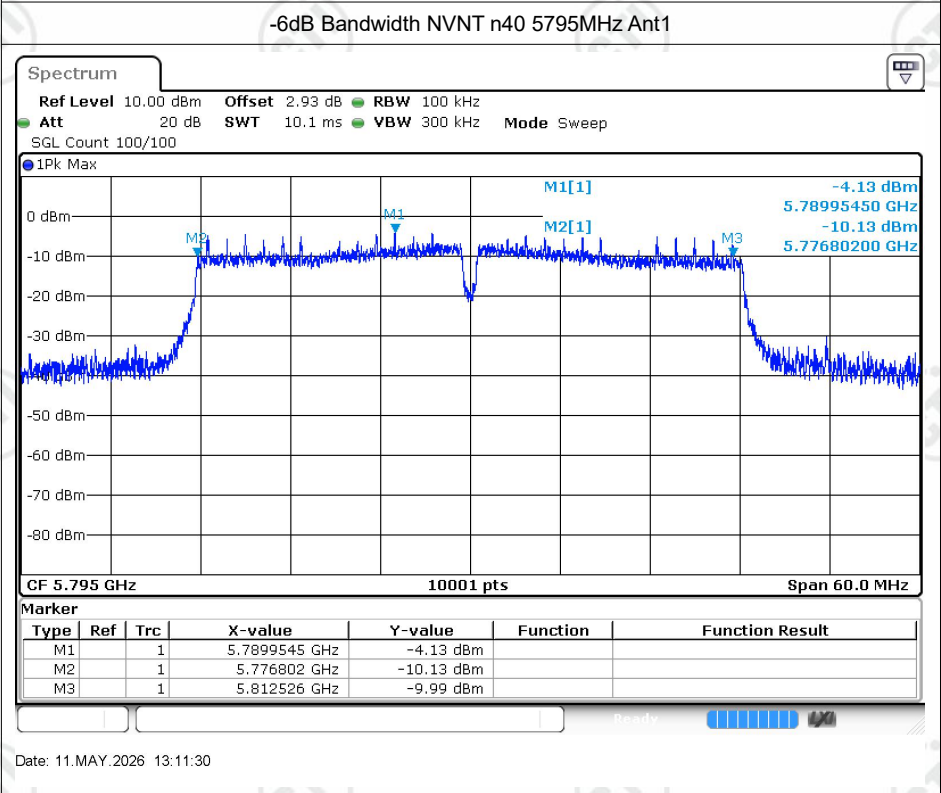


Date: 11.MAY.2026 13:11:30

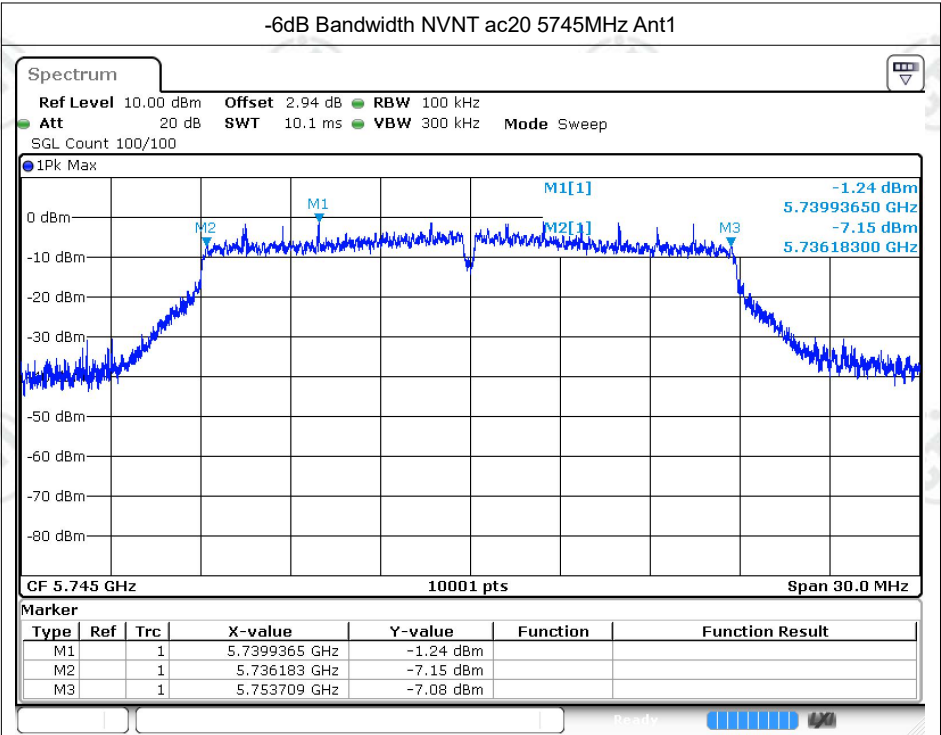


Date: 11.MAY.2026 13:13:17

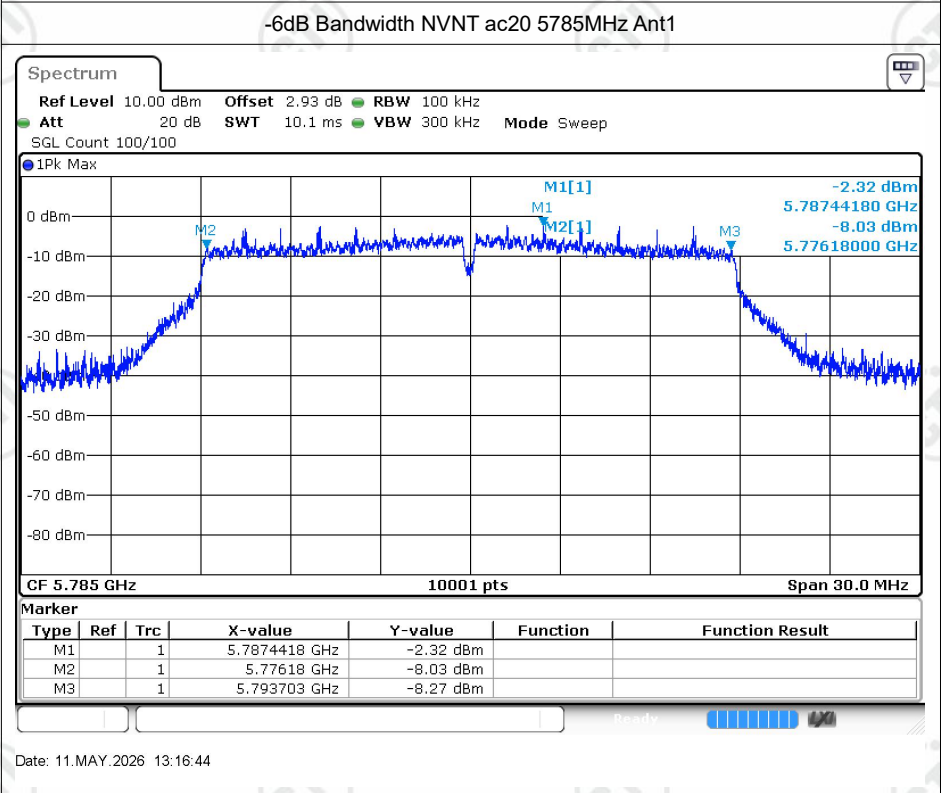

Date: 11.MAY.2026 13:16:44

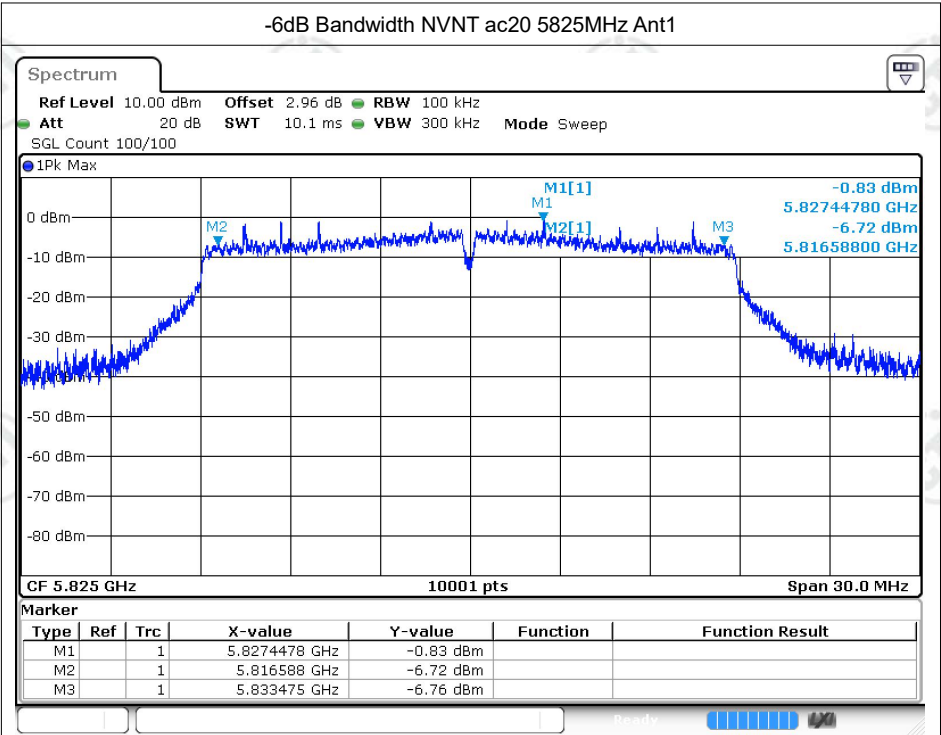

Date: 11.MAY.2026 13:28:32

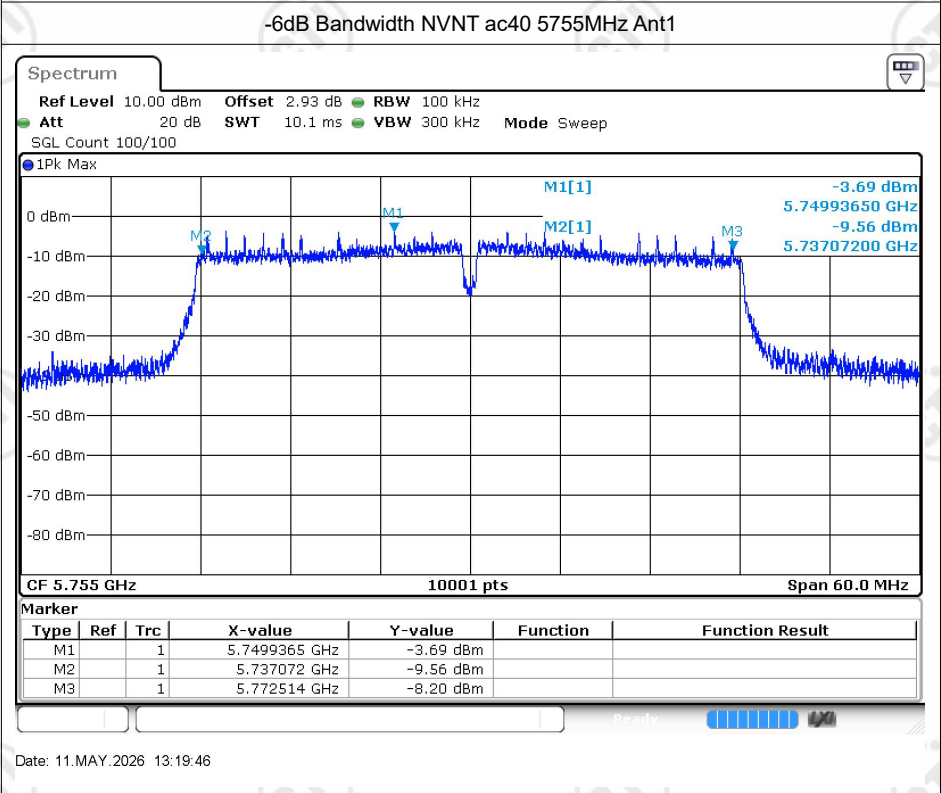

Date: 11.MAY.2026 13:19:46