

					20000MHz		
Band2	20MHz	QPSK	18700	1RB#0	Range1:30~1000MHz	-48.26	PASS
Band2	20MHz	QPSK	18700	1RB#0	Range2:1000~20000MHz	-32.69	PASS
Band2	20MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-48.72	PASS
Band2	20MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.56	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range1:30~1000MHz	-48.39	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range2:1000~20000MHz	-33.67	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range1:30~1000MHz	-47.86	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range2:1000~20000MHz	-33.18	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-48.07	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.04	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range1:30~1000MHz	-47.98	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range2:1000~20000MHz	-32.96	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
www.anbotek.com.cn




Test Graphs

Band2-1.4MHz-QPSK-18607-1RB#0-Range1:30~1000MHz

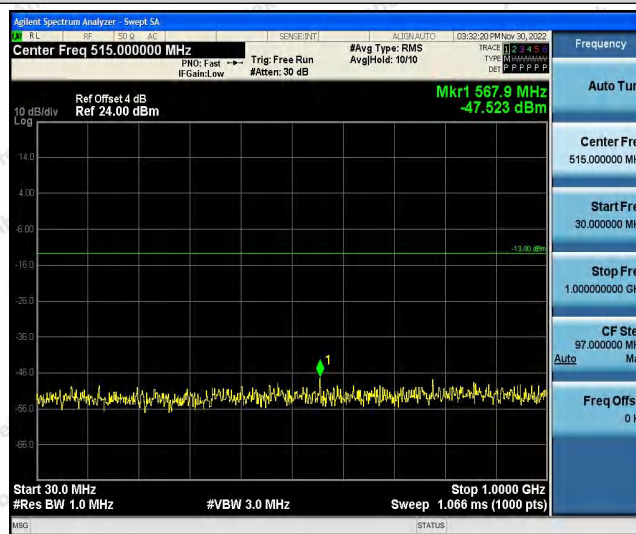

Band2-1.4MHz-QPSK-18607-1RB#0-Range2:1000~20000MHz

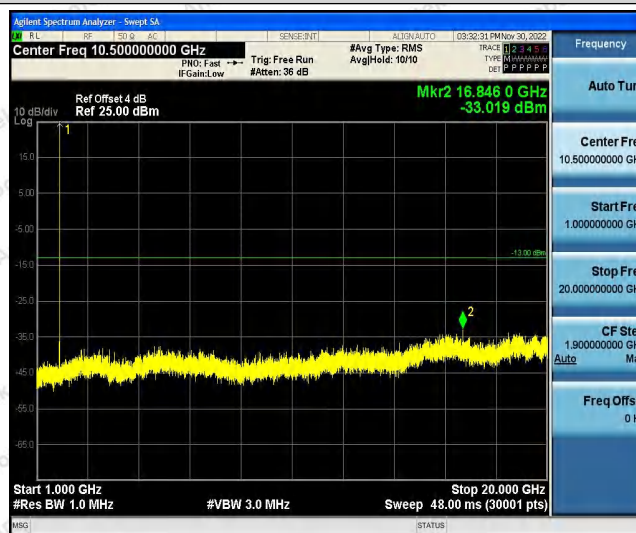

Band2-1.4MHz-QPSK-18900-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




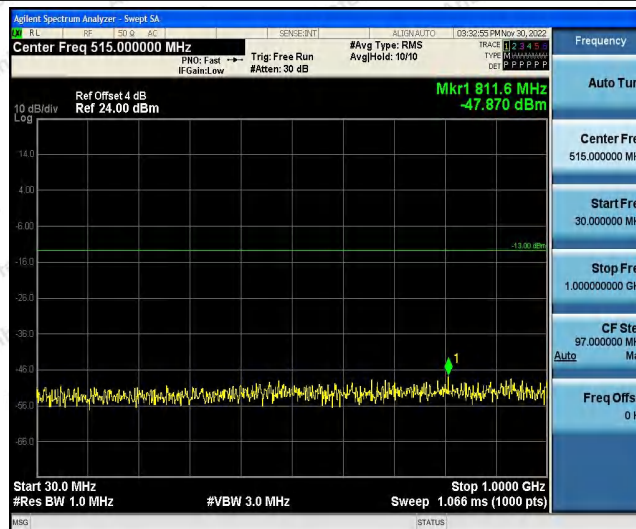

Band2-1.4MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

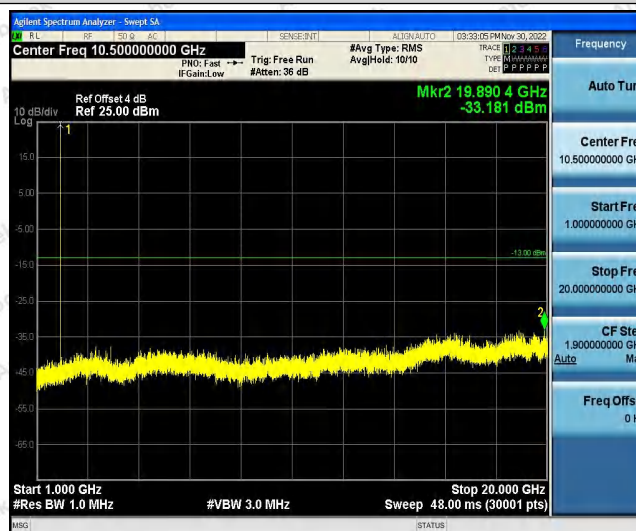

Band2-1.4MHz-QPSK-19193-1RB#0-Range1:30~1000MHz

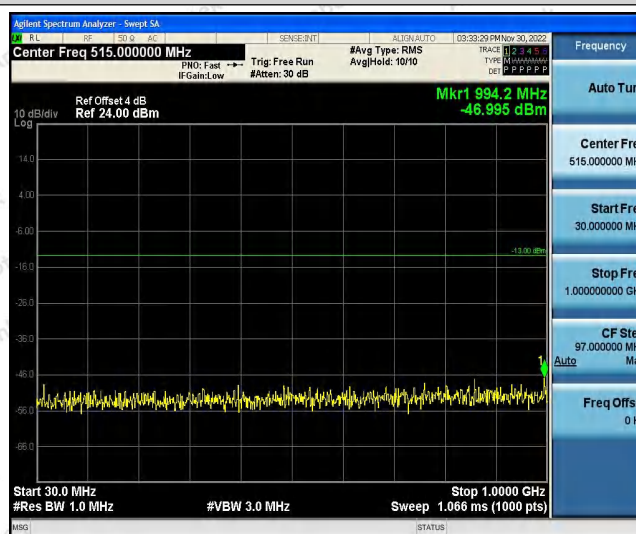

Band2-1.4MHz-QPSK-19193-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band2-1.4MHz-16QAM-18607-1RB#0-Range1:30~1000MHz

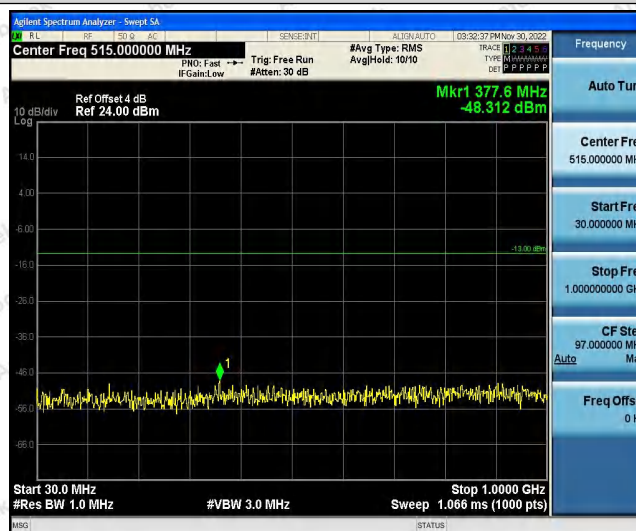


Band2-1.4MHz-16QAM-18607-1RB#0-Range2:1000~20000MHz




Band2-1.4MHz-16QAM-18900-1RB#0-Range1:30~1000MHz




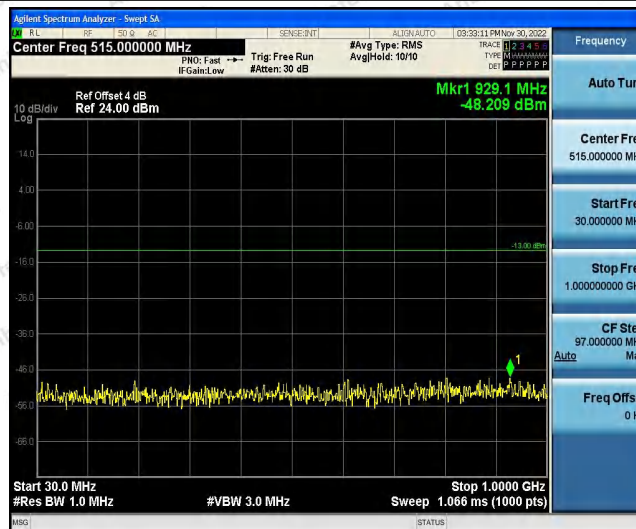

Band2-1.4MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

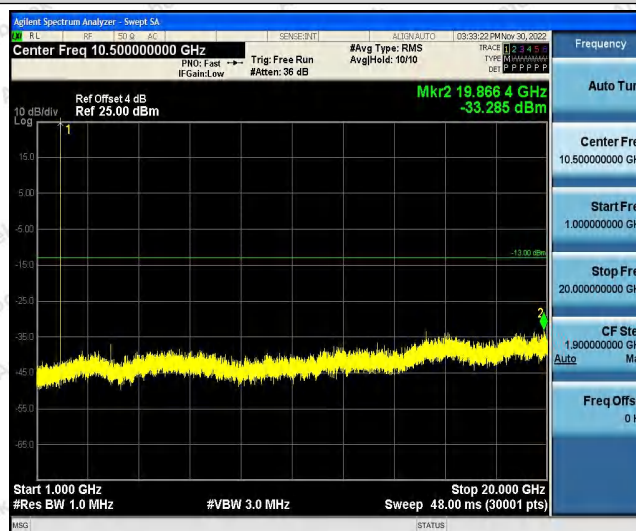

Band2-1.4MHz-16QAM-19193-1RB#0-Range1:30~1000MHz

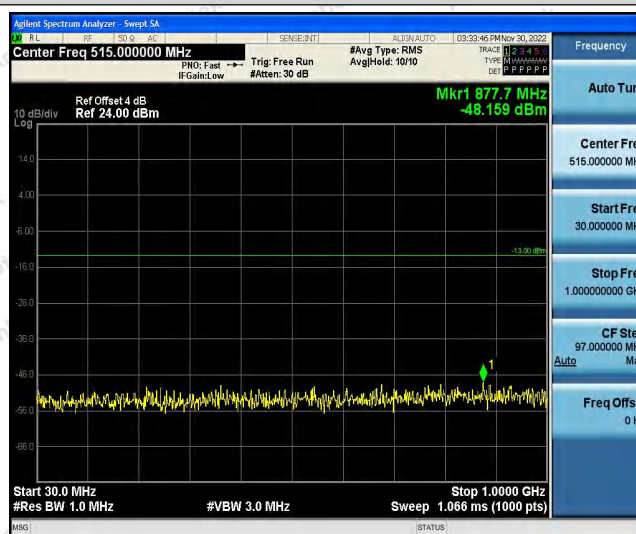

Band2-1.4MHz-16QAM-19193-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



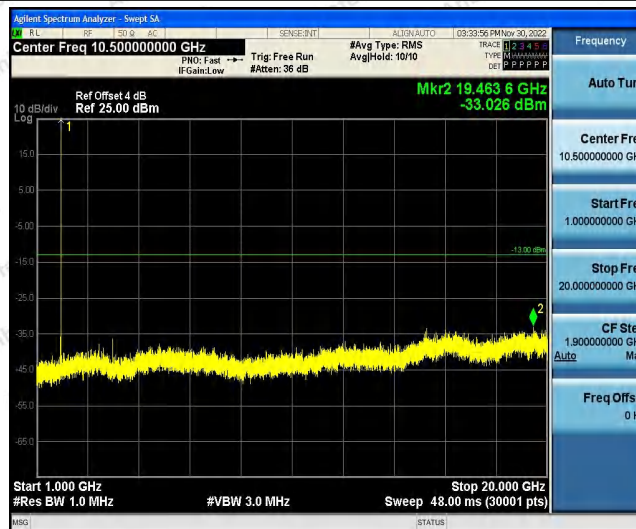

Band2-3MHz-QPSK-18615-1RB#0-Range1:30~1000MHz

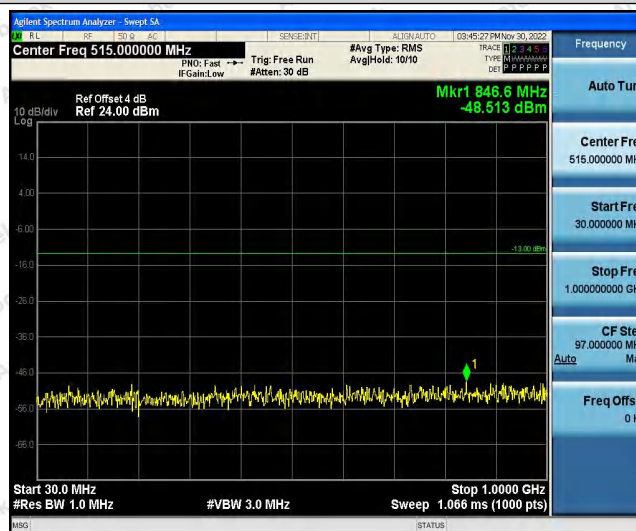

Band2-3MHz-QPSK-18615-1RB#0-Range2:1000~20000MHz



Band2-3MHz-QPSK-18900-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




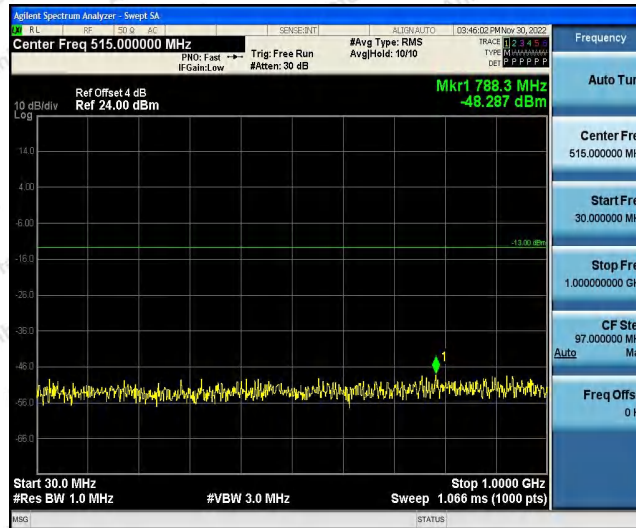

Band2-3MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

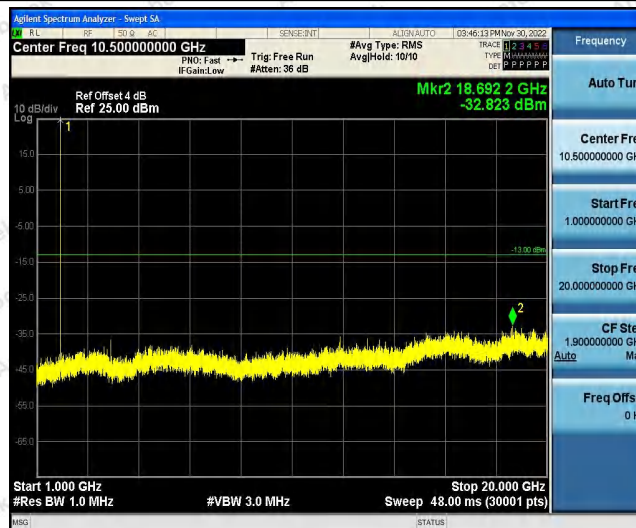


Band2-3MHz-QPSK-19185-1RB#0-Range1:30~1000MHz

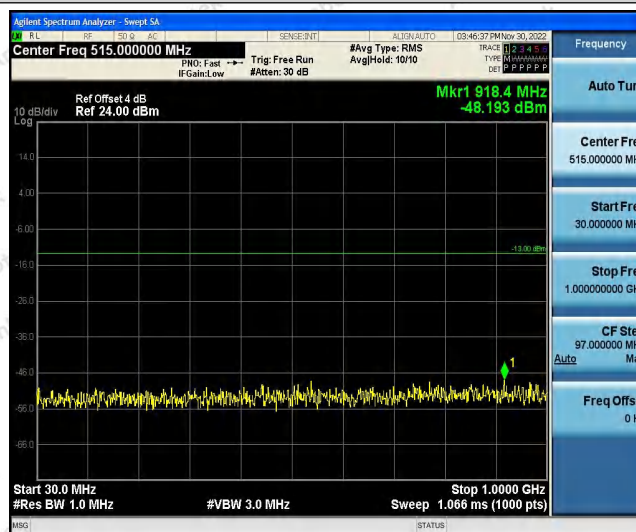


Band2-3MHz-QPSK-19185-1RB#0-Range2:1000~20000MHz




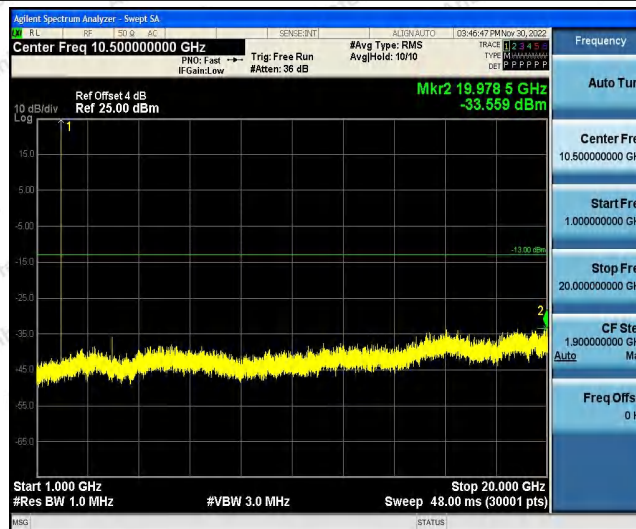

Band2-3MHz-16QAM-18615-1RB#0-Range1:30~1000MHz

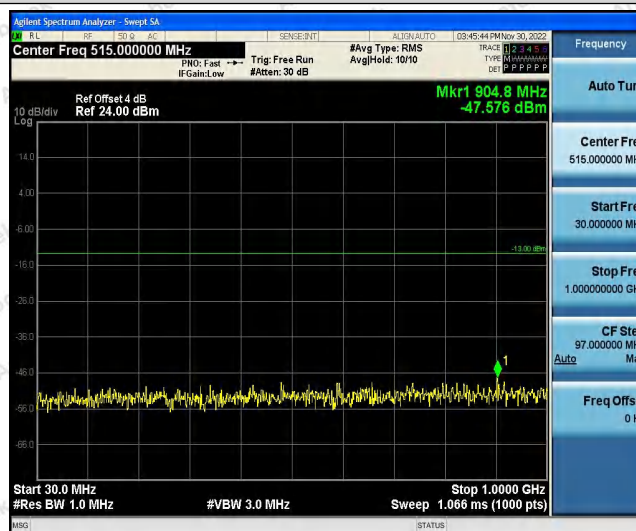

Band2-3MHz-16QAM-18615-1RB#0-Range2:1000~20000MHz

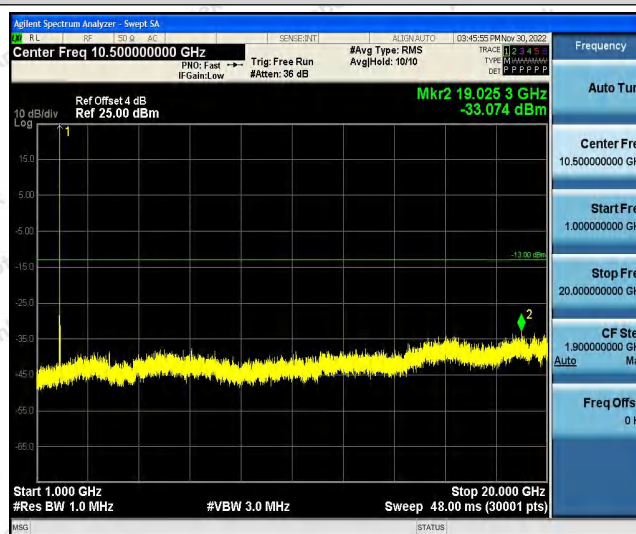

Band2-3MHz-16QAM-18900-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




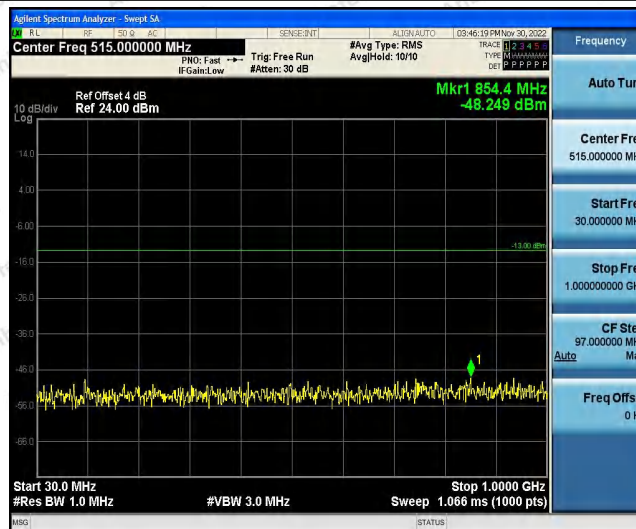

Band2-3MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

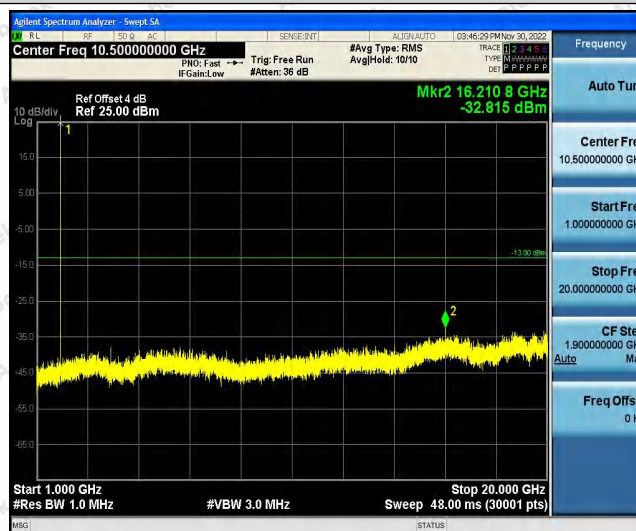

Band2-3MHz-16QAM-19185-1RB#0-Range1:30~1000MHz

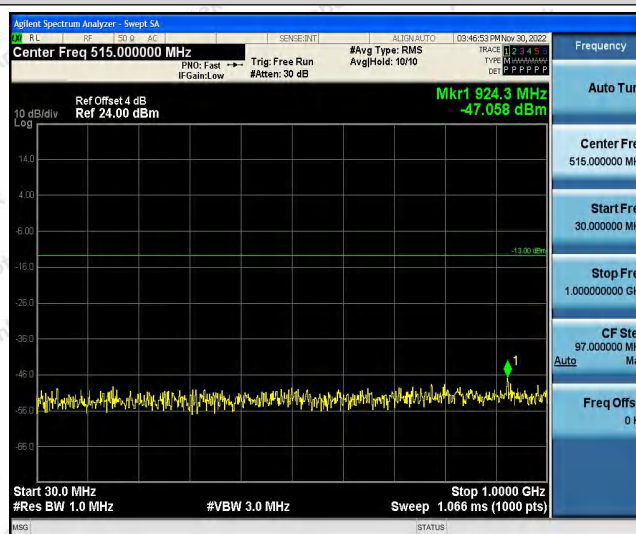

Band2-3MHz-16QAM-19185-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band2-5MHz-QPSK-18625-1RB#0-Range1:30~1000MHz

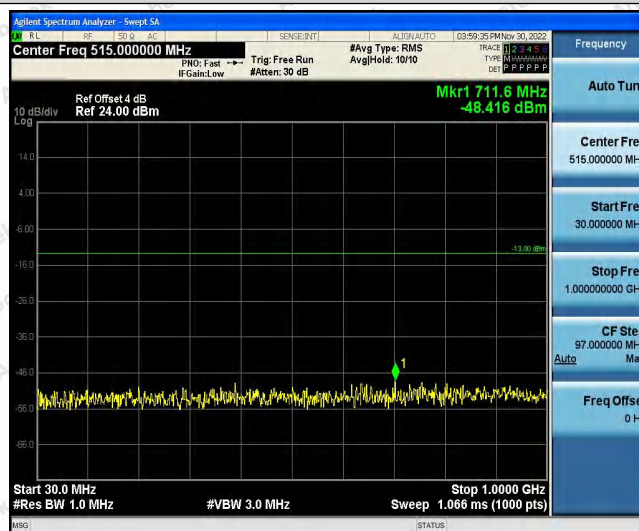

Band2-5MHz-QPSK-18625-1RB#0-Range2:1000~20000MHz

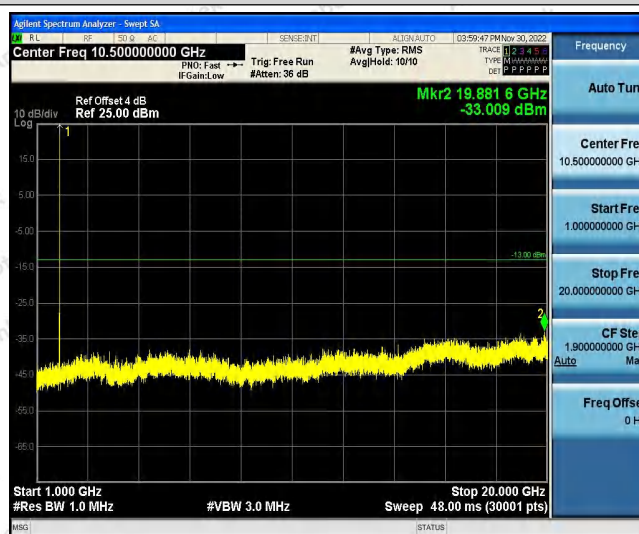

Band2-5MHz-QPSK-18900-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




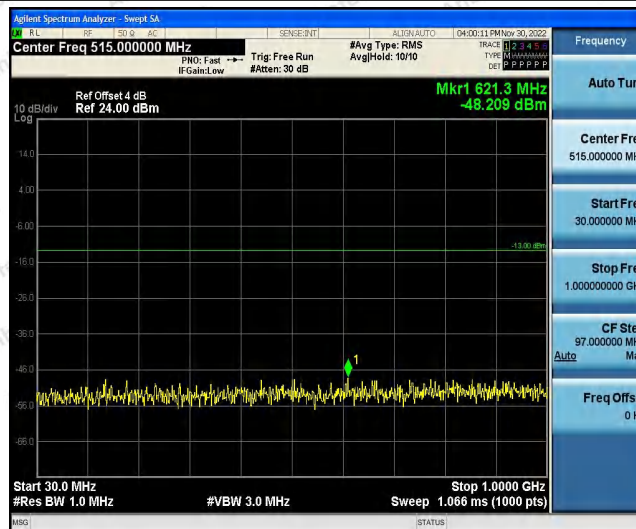

Band2-5MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

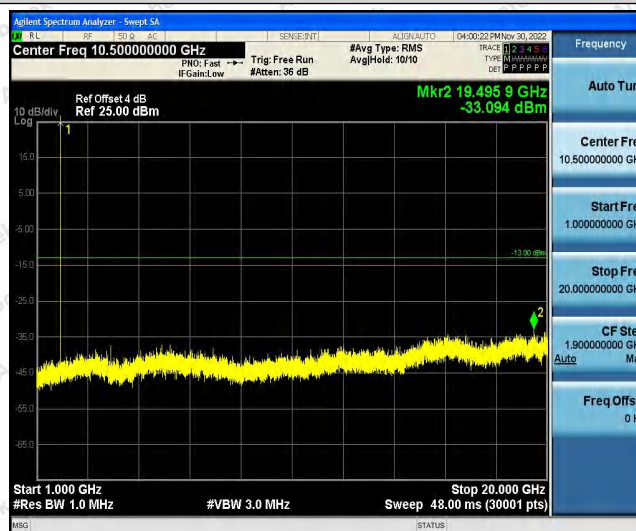

Band2-5MHz-QPSK-19175-1RB#0-Range1:30~1000MHz

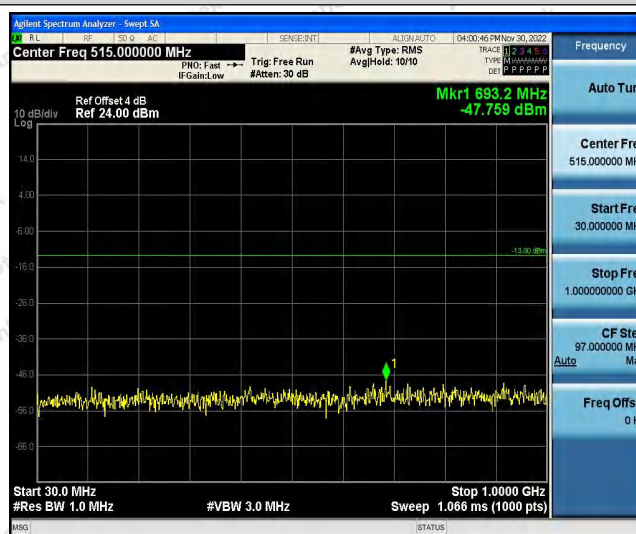

Band2-5MHz-QPSK-19175-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band2-5MHz-16QAM-18625-1RB#0-Range1:30~1000MHz

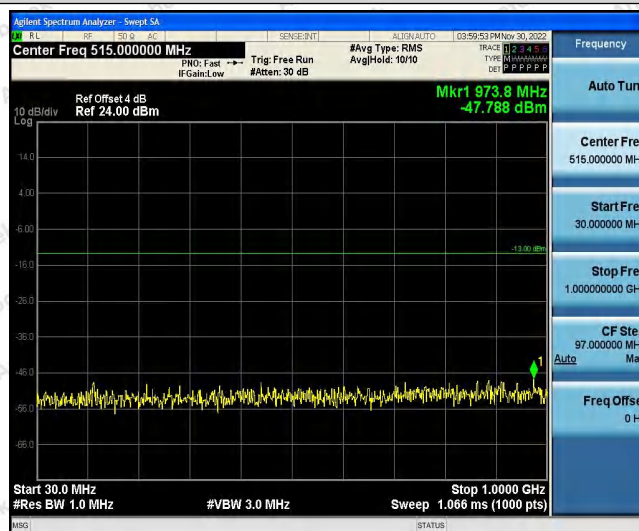

Band2-5MHz-16QAM-18625-1RB#0-Range2:1000~20000MHz

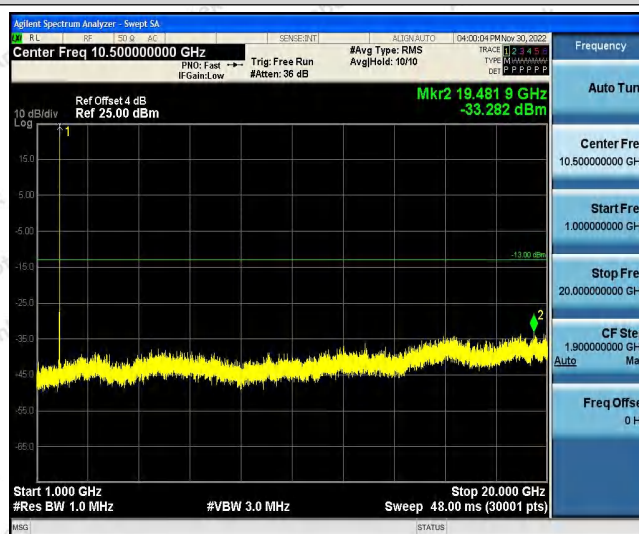

Band2-5MHz-16QAM-18900-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




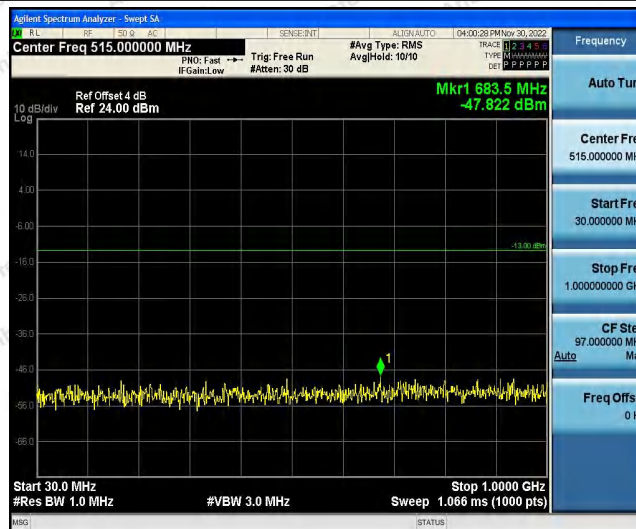

Band2-5MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

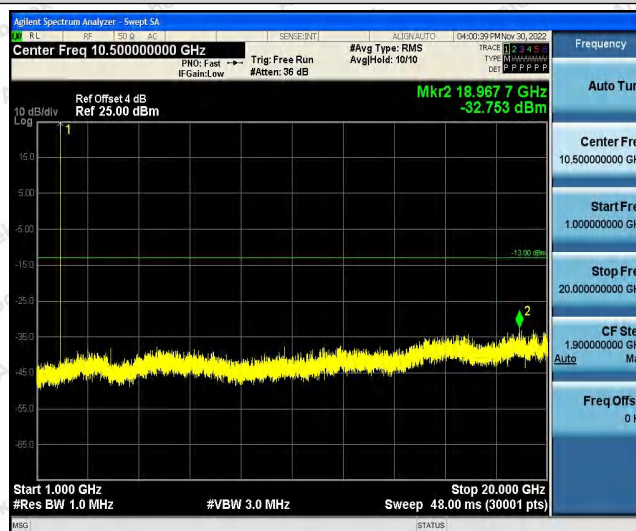

Band2-5MHz-16QAM-19175-1RB#0-Range1:30~1000MHz

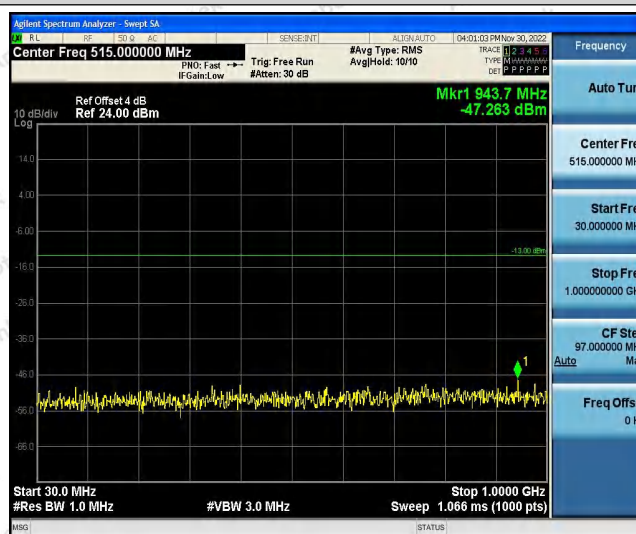

Band2-5MHz-16QAM-19175-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band2-10MHz-QPSK-18650-1RB#0-Range1:30~1000MHz

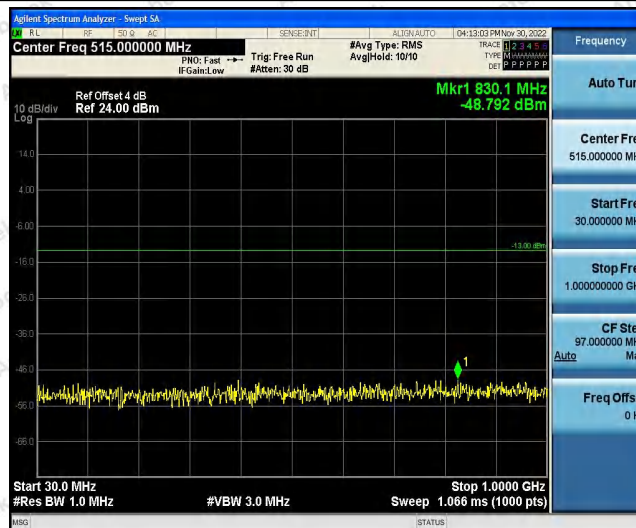

Band2-10MHz-QPSK-18650-1RB#0-Range2:1000~20000MHz

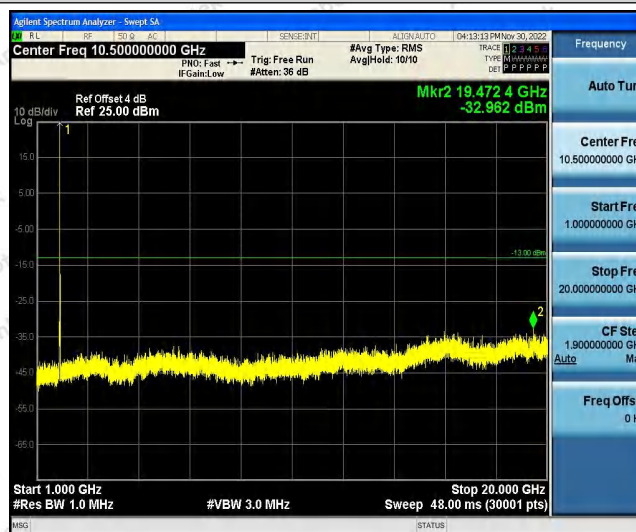

Band2-10MHz-QPSK-18900-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




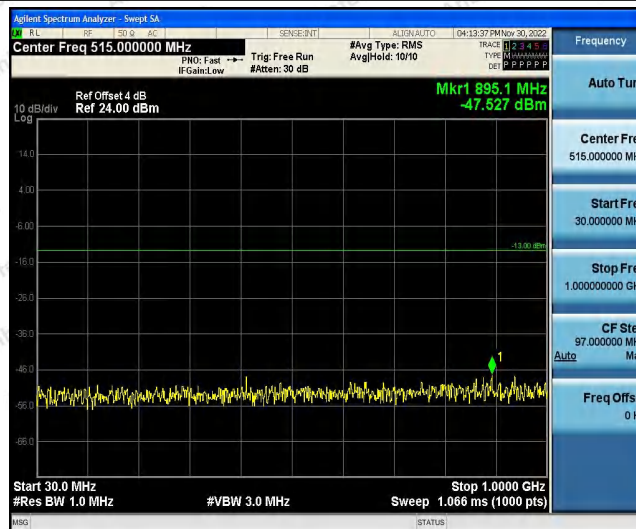

Band2-10MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

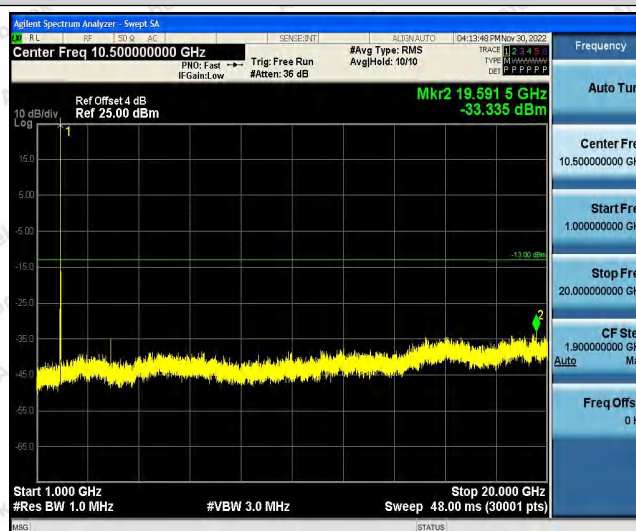

Band2-10MHz-QPSK-19150-1RB#0-Range1:30~1000MHz

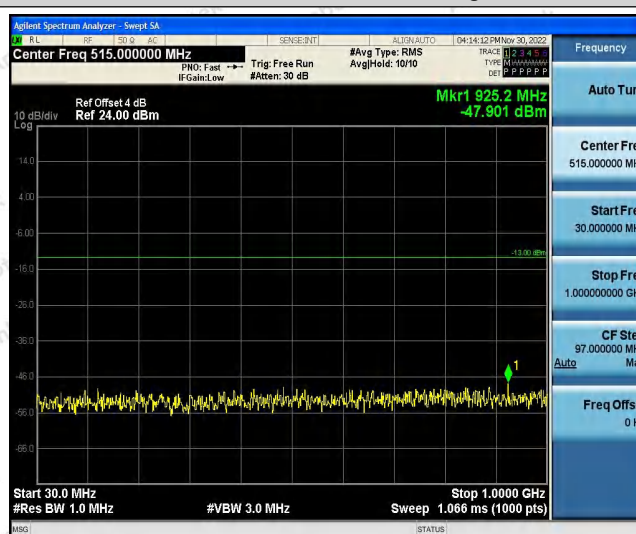

Band2-10MHz-QPSK-19150-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band2-10MHz-16QAM-18650-1RB#0-Range1:30~1000MHz

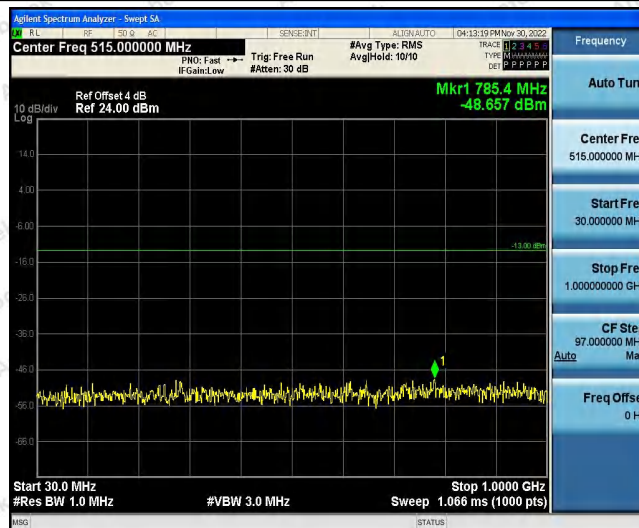

Band2-10MHz-16QAM-18650-1RB#0-Range2:1000~20000MHz

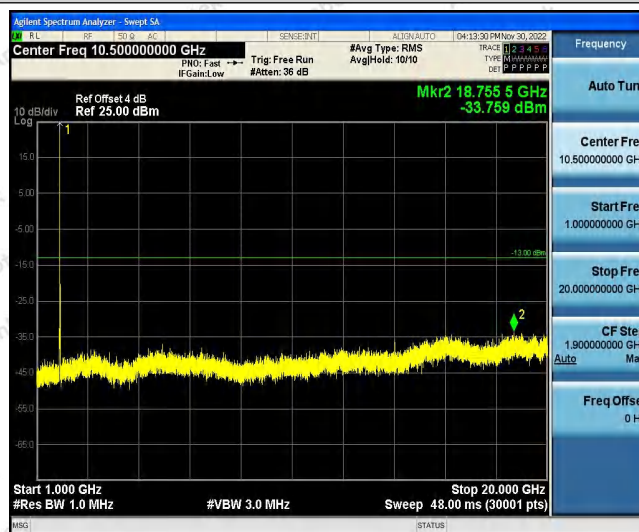

Band2-10MHz-16QAM-18900-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




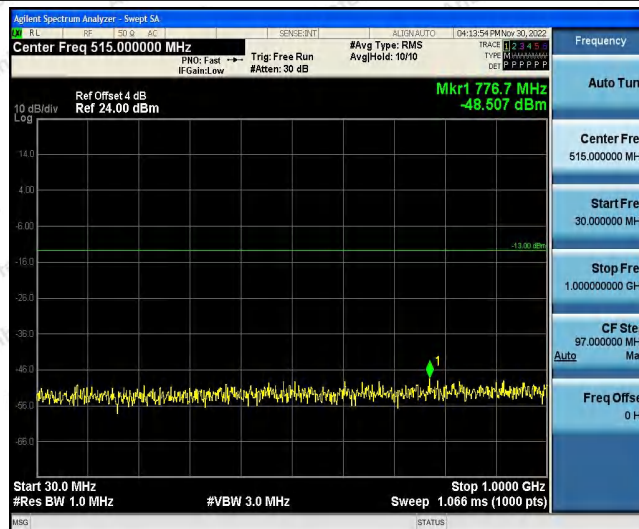

Band2-10MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

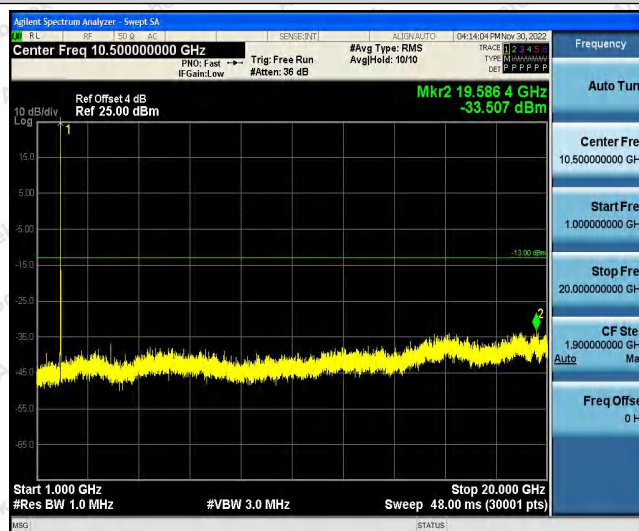

Band2-10MHz-16QAM-19150-1RB#0-Range1:30~1000MHz

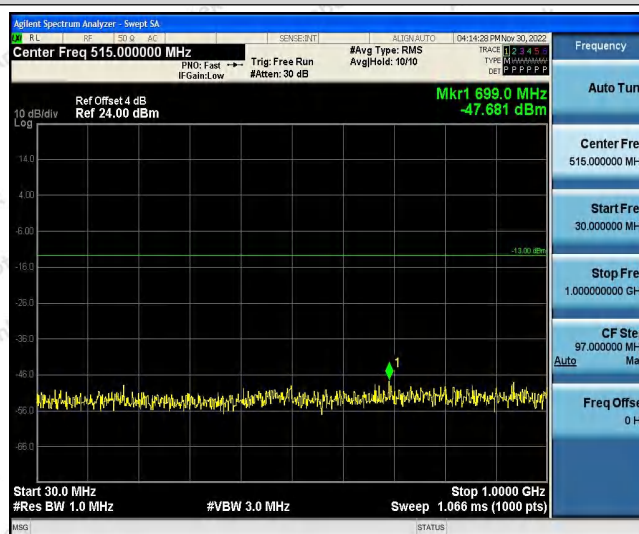

Band2-10MHz-16QAM-19150-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



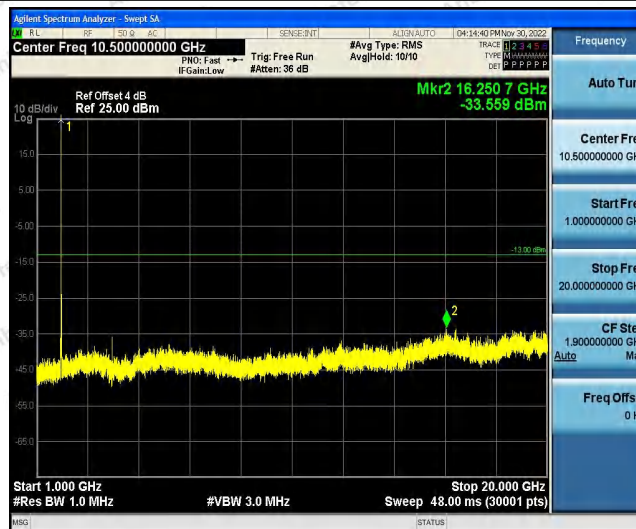

Band2-15MHz-QPSK-18675-1RB#0-Range1:30~1000MHz

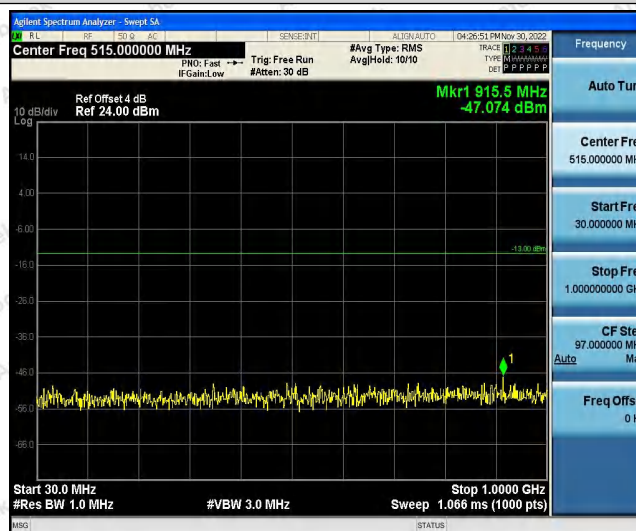

Band2-15MHz-QPSK-18675-1RB#0-Range2:1000~20000MHz



Band2-15MHz-QPSK-18900-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




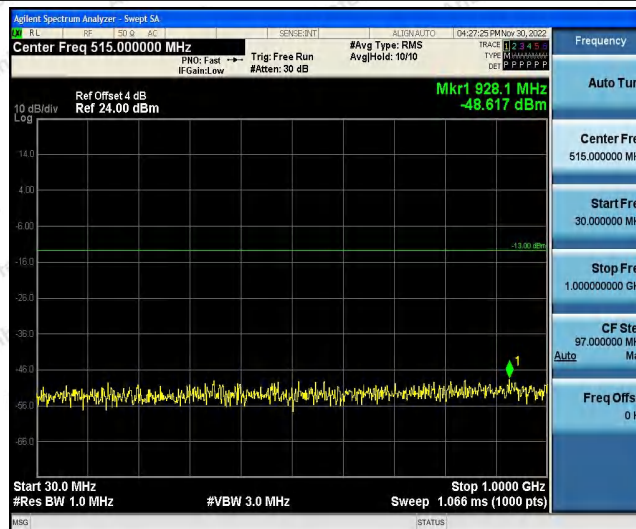

Band2-15MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

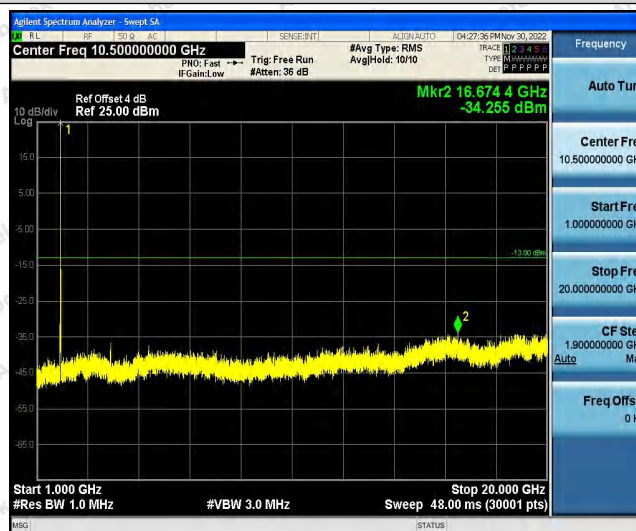

Band2-15MHz-QPSK-19125-1RB#0-Range1:30~1000MHz

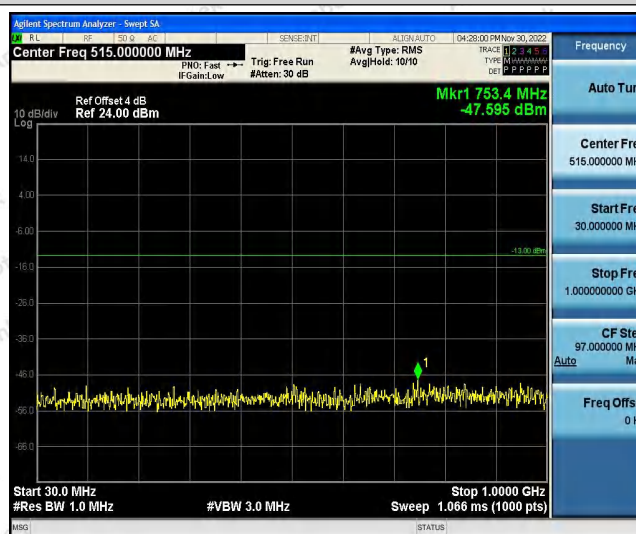

Band2-15MHz-QPSK-19125-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




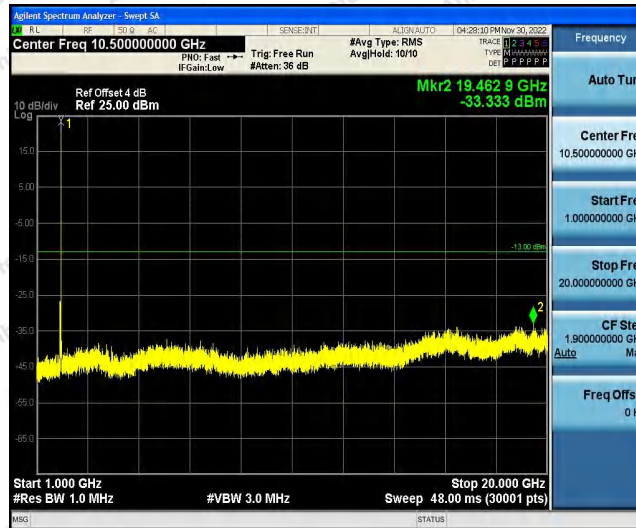

Band2-15MHz-16QAM-18675-1RB#0-Range1:30~1000MHz

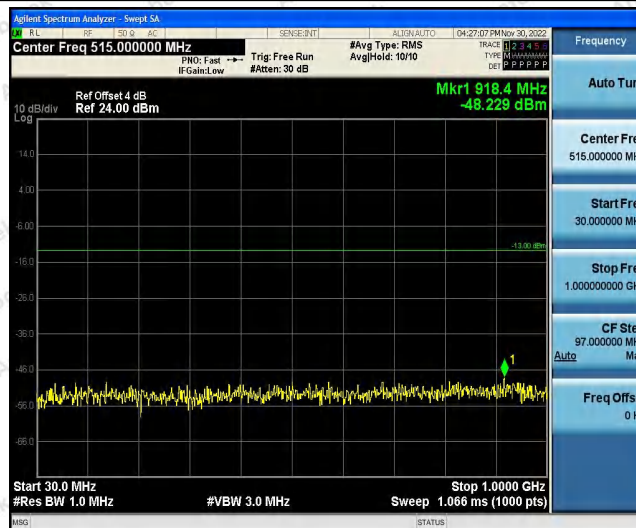

Band2-15MHz-16QAM-18675-1RB#0-Range2:1000~20000MHz

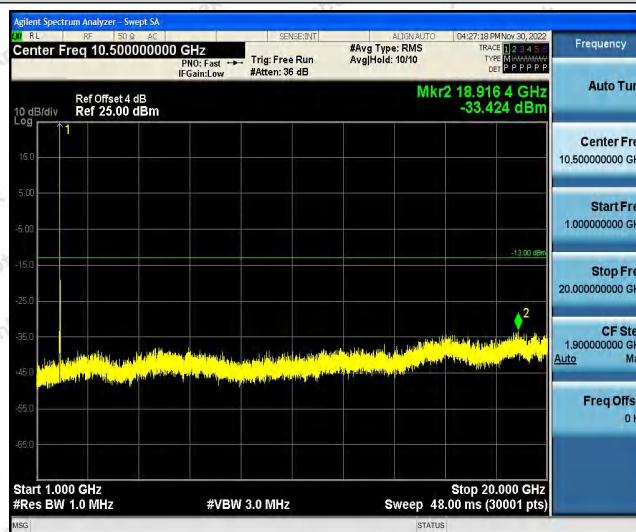

Band2-15MHz-16QAM-18900-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




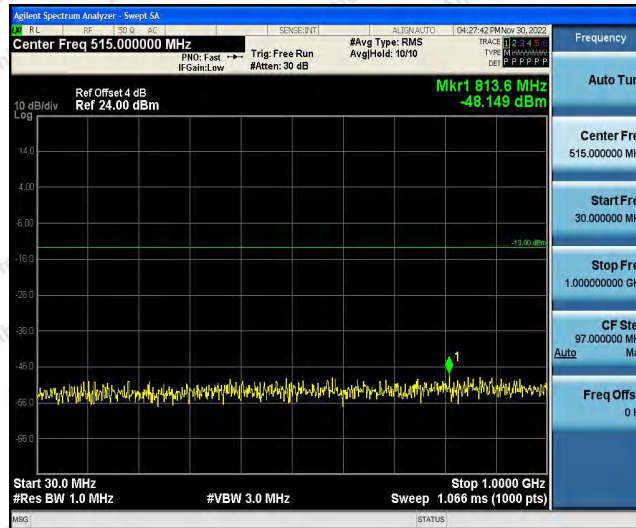

Band2-15MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

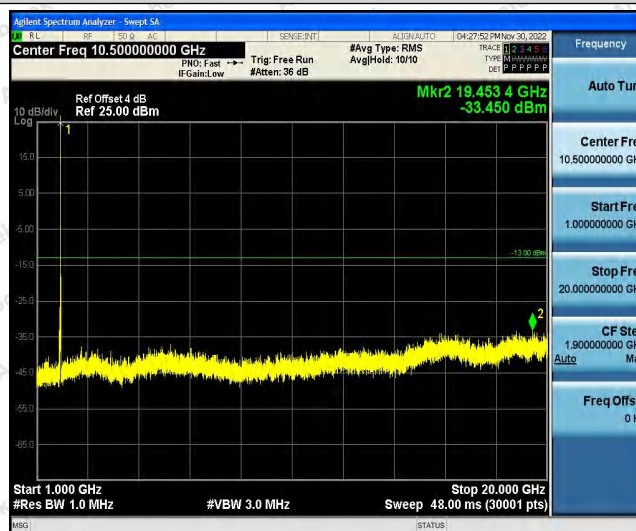

Band2-15MHz-16QAM-19125-1RB#0-Range1:30~1000MHz

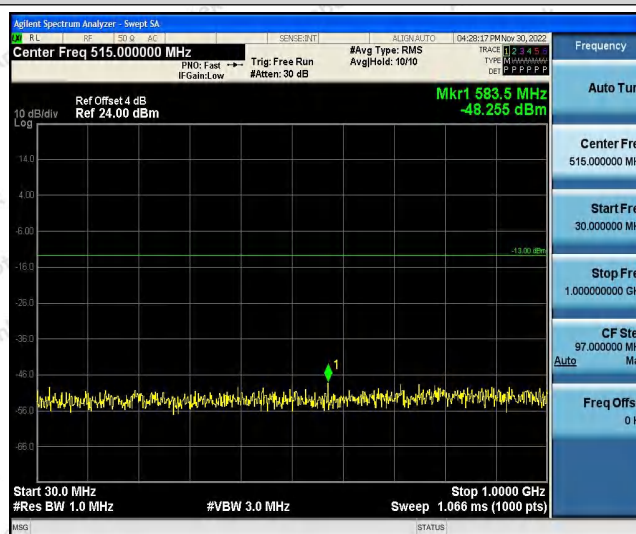


Band2-15MHz-16QAM-19125-1RB#0-Range2:1000~20000MHz





Band2-20MHz-QPSK-18700-1RB#0-Range1:30~1000MHz

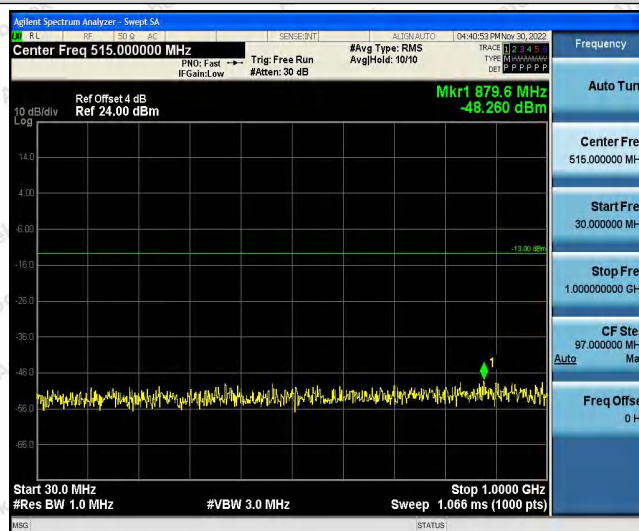

Band2-20MHz-QPSK-18700-1RB#0-Range2:1000~20000MHz



Band2-20MHz-QPSK-18900-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




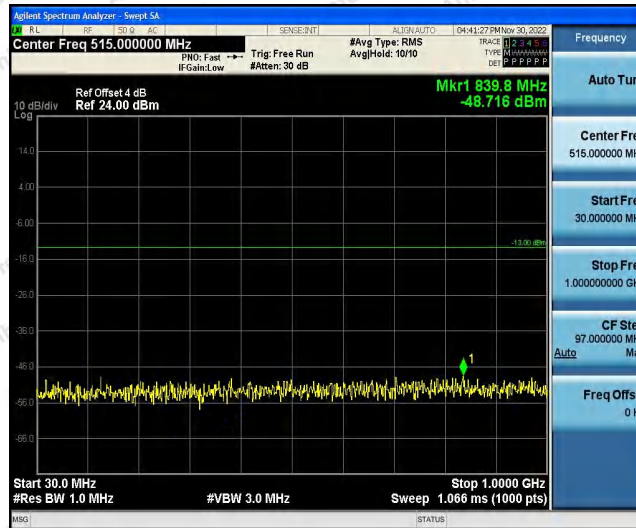

Band2-20MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

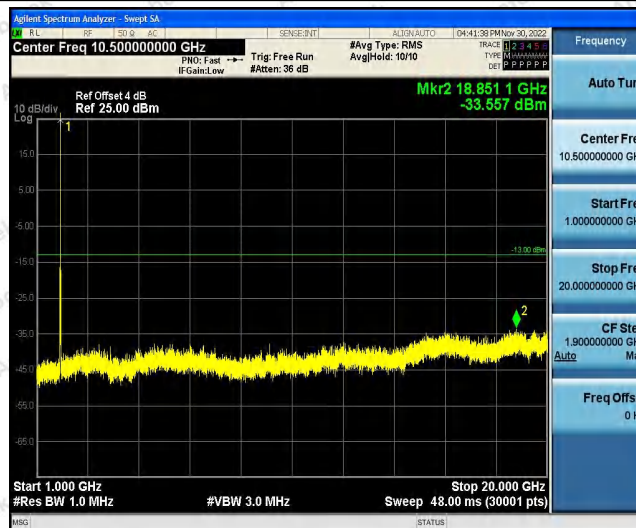

Band2-20MHz-QPSK-19100-1RB#0-Range1:30~1000MHz

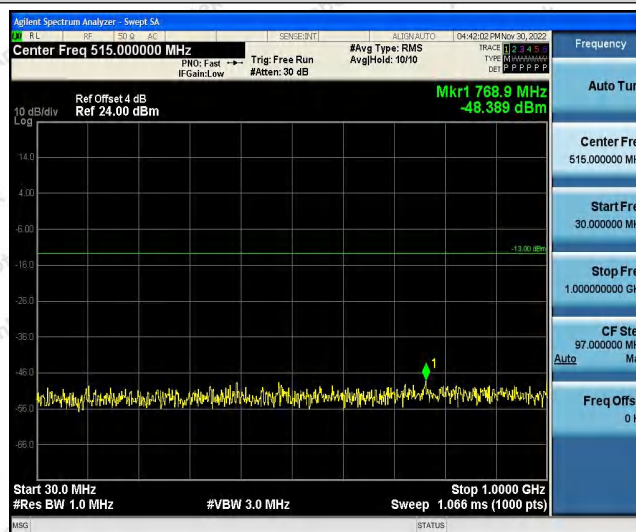

Band2-20MHz-QPSK-19100-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band2-20MHz-16QAM-18700-1RB#0-Range1:30~1000MHz

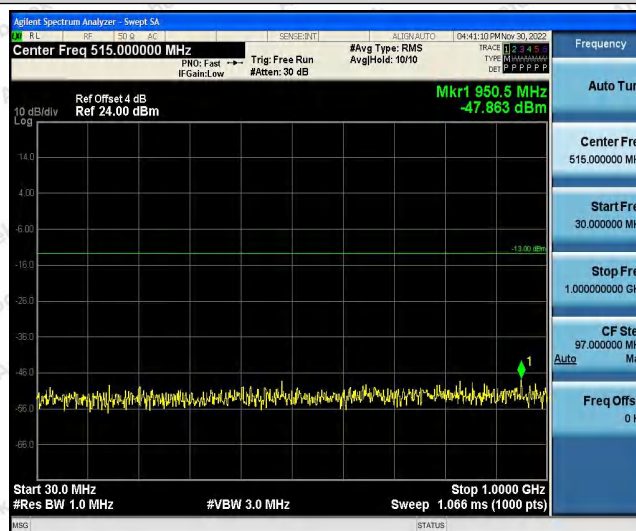

Band2-20MHz-16QAM-18700-1RB#0-Range2:1000~20000MHz



Band2-20MHz-16QAM-18900-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




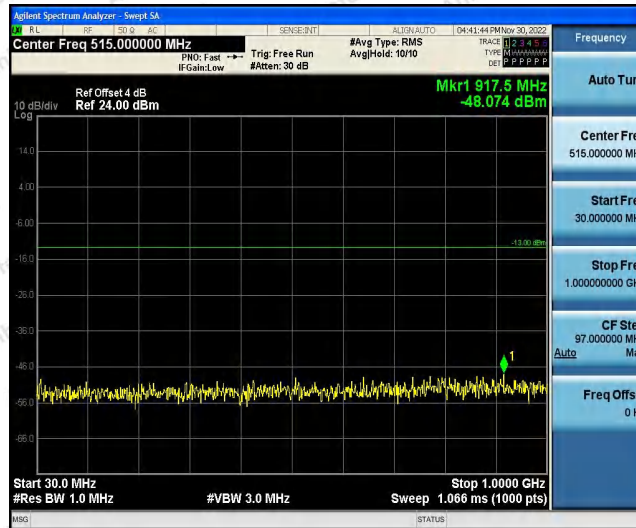

Band2-20MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

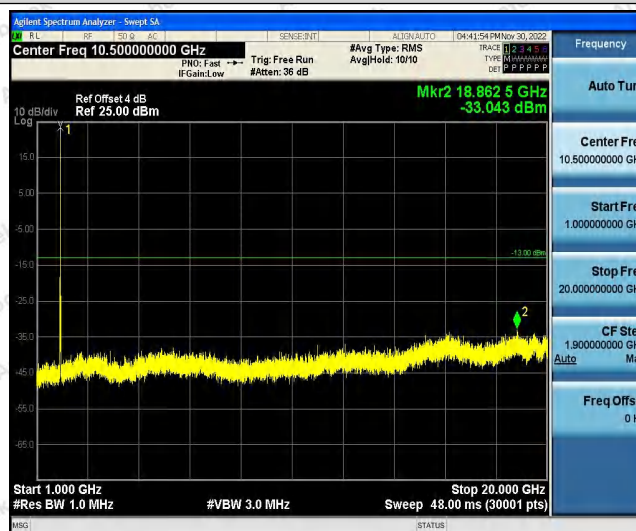

Band2-20MHz-16QAM-19100-1RB#0-Range1:30~1000MHz

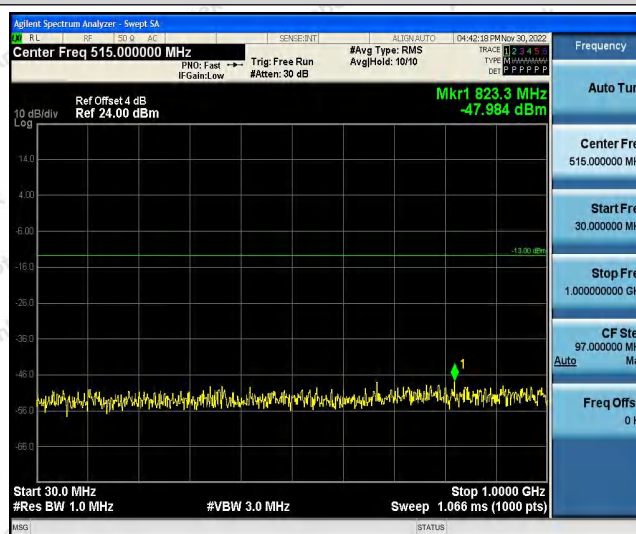

Band2-20MHz-16QAM-19100-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn

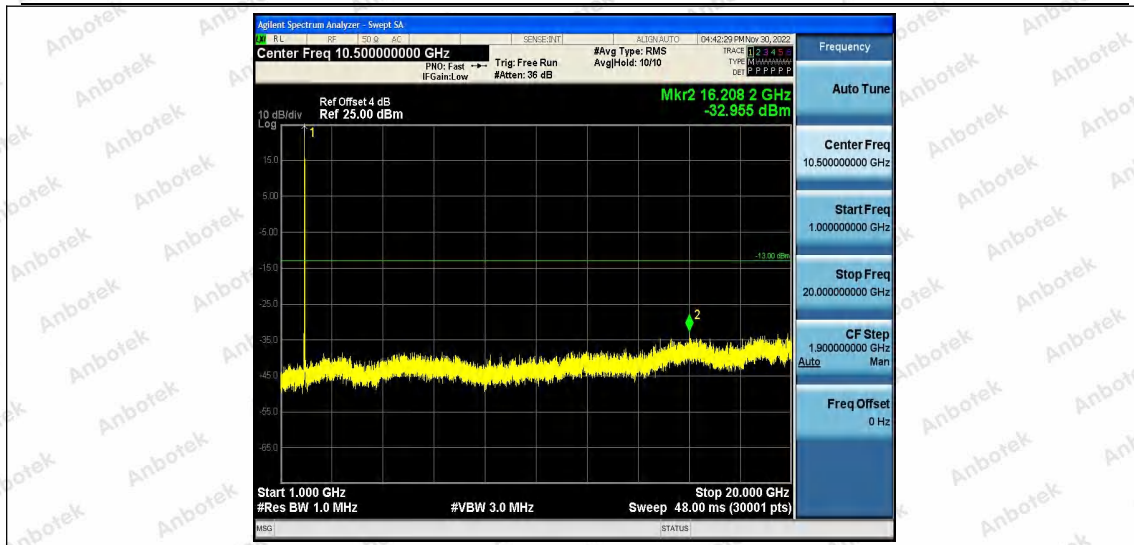

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-12.50	-0.006754	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-5.69	-0.003075	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-12.22	-0.006603	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-10.14	-0.005394	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	10.03	0.005335	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-7.25	-0.003856	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-6.05	-0.003169	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-2.52	-0.001320	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-13.03	-0.006824	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-4.01	-0.002167	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-9.84	-0.005317	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-4.18	-0.002259	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-11.70	-0.006223	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-6.77	-0.003601	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	4.79	0.002548	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	-14.15	-0.007411	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-4.96	-0.002598	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-12.49	-0.006542	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-14.00	-0.007561	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-6.01	-0.003246	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-14.69	-0.007934	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-9.46	-0.005032	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	5.81	0.003090	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-16.62	-0.008840	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	-4.79	-0.002510	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	-5.18	-0.002714	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	-13.73	-0.007194	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-10.20	-0.005509	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-11.64	-0.006287	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-7.40	-0.003997	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-5.28	-0.002809	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-11.99	-0.006378	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-9.24	-0.004915	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	-10.20	-0.005345	±2.5	PASS



Band2	3MHz	16QAM	19185	15RB#0	VN	NT	-10.79	-0.005654	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	-7.57	-0.003966	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-15.42	-0.008324	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-7.00	-0.003779	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-6.25	-0.003374	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-17.87	-0.009505	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-6.65	-0.003537	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-13.18	-0.007011	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-9.93	-0.005206	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	7.80	0.004089	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	-10.76	-0.005641	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-7.81	-0.004216	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-12.26	-0.006618	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-4.92	-0.002656	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-10.93	-0.005814	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-9.98	-0.005309	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-10.66	-0.005670	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	-35.06	-0.018380	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	-7.38	-0.003869	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-5.91	-0.003098	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-10.94	-0.005898	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-7.97	-0.004296	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-6.88	-0.003709	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-12.56	-0.006681	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-10.43	-0.005548	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-15.44	-0.008213	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-13.36	-0.007013	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	5.18	0.002719	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	-8.81	-0.004625	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	-9.68	-0.005218	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-8.35	-0.004501	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-8.00	-0.004313	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	-11.24	-0.005979	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	-10.37	-0.005516	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	-9.30	-0.004947	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	-7.45	-0.003911	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	-8.68	-0.004556	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	-7.91	-0.004152	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-4.18	-0.002250	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-6.11	-0.003289	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-9.91	-0.005335	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-11.76	-0.006255	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-6.98	-0.003713	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-10.91	-0.005803	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-11.24	-0.005908	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-5.18	-0.002723	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-15.12	-0.007947	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	-4.91	-0.002643	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	-11.56	-0.006223	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	-4.41	-0.002374	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-11.84	-0.006298	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	-11.01	-0.005856	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-12.46	-0.006628	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	-9.23	-0.004852	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	-6.24	-0.003280	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	-7.75	-0.004074	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	-5.26	-0.002828	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	-5.65	-0.003038	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	-7.11	-0.003823	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-13.88	-0.007383	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	-5.84	-0.003106	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-12.03	-0.006399	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-8.93	-0.004700	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-2.95	-0.001553	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-12.22	-0.006432	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	-4.52	-0.002430	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	-7.93	-0.004263	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	-6.02	-0.003237	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	-12.37	-0.006580	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	-9.74	-0.005181	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	-8.04	-0.004277	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	-4.43	-0.002332	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-5.32	-0.002800	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-4.35	-0.002289	±2.5	PASS



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-8.18	-0.004420	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-7.97	-0.004306	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-9.57	-0.005171	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-5.64	-0.003047	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-7.20	-0.003890	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-8.57	-0.004559	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-7.30	-0.003883	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-5.51	-0.002931	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-4.43	-0.002356	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-6.54	-0.003479	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	-11.62	-0.006086	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	-13.03	-0.006824	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	-6.69	-0.003504	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	-7.04	-0.003687	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	-10.89	-0.005704	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-4.28	-0.002313	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-6.62	-0.003577	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-8.31	-0.004490	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-4.28	-0.002313	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-5.85	-0.003161	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-7.90	-0.004202	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-2.15	-0.001144	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-7.38	-0.003926	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-9.10	-0.004840	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-9.03	-0.004803	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	-13.69	-0.007170	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	-9.28	-0.004860	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	-12.17	-0.006374	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	-13.92	-0.007291	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	-11.17	-0.005850	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-12.72	-0.006870	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-8.40	-0.004537	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-11.39	-0.006152	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-5.95	-0.003214	±2.5	PASS



Band2	3MHz	QPSK	18615	15RB#0	NV	20	-7.97	-0.004305	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-5.22	-0.002777	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-12.35	-0.006569	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-7.14	-0.003798	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-10.11	-0.005378	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	-10.51	-0.005590	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	-4.95	-0.002594	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	-16.31	-0.008546	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	-12.76	-0.006686	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	-8.03	-0.004207	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	-4.32	-0.002264	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-10.74	-0.005801	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-7.70	-0.004159	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-5.42	-0.002927	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	-8.35	-0.004510	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	-8.28	-0.004472	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	-11.69	-0.006218	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-5.06	-0.002691	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	-8.01	-0.004261	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	-2.96	-0.001574	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-8.58	-0.004564	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	6.78	0.003553	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	-9.47	-0.004962	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	-3.72	-0.001949	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	-7.50	-0.003930	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	-5.11	-0.002677	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	-7.67	-0.004140	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	-4.86	-0.002623	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-5.66	-0.003055	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-7.35	-0.003968	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-6.38	-0.003444	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-9.04	-0.004809	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-15.08	-0.008021	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-9.11	-0.004846	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-8.35	-0.004441	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-13.52	-0.007191	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	-3.29	-0.001725	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	-10.41	-0.005457	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	-5.25	-0.002752	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	-7.54	-0.003953	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	-5.51	-0.002889	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
www.anbotek.com.cn



Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-9.80	-0.005290	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-10.47	-0.005652	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	-7.78	-0.004200	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	-4.98	-0.002688	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-3.86	-0.002084	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	-8.51	-0.004527	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	-8.58	-0.004564	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	-13.52	-0.007191	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	-13.15	-0.006995	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-13.63	-0.007250	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	-5.39	-0.002826	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	-7.97	-0.004178	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	3.60	0.001887	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	-4.95	-0.002595	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	-8.18	-0.004288	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-9.41	-0.005073	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-8.00	-0.004313	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	-9.50	-0.005121	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-4.88	-0.002631	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-11.89	-0.006410	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-12.36	-0.006574	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-16.31	-0.008676	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-10.93	-0.005814	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-10.34	-0.005500	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-12.06	-0.006415	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	-8.80	-0.004619	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	-8.05	-0.004226	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	-7.97	-0.004184	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	-12.16	-0.006383	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	-9.74	-0.005113	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	3.59	0.001935	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	3.35	0.001806	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	-6.25	-0.003369	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	3.98	0.002146	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	-9.53	-0.005137	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	-11.67	-0.006207	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	-16.52	-0.008787	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	-13.00	-0.006915	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	-14.39	-0.007654	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	-6.22	-0.003309	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	-12.16	-0.006383	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	10MHz	16QAM	19150	50RB#0	NV	-20	-5.76	-0.003024	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	0	-11.92	-0.006257	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	-6.37	-0.003344	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	-8.11	-0.004257	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-11.09	-0.005970	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-5.16	-0.002778	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-3.10	-0.001669	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-7.94	-0.004275	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-6.37	-0.003429	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-9.77	-0.005197	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-11.50	-0.006117	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	-10.90	-0.005798	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-12.73	-0.006771	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-11.00	-0.005851	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-13.18	-0.006928	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-13.22	-0.006949	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-10.13	-0.005325	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-13.02	-0.006844	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-11.24	-0.005908	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	-7.34	-0.003952	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	-5.19	-0.002794	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	-7.20	-0.003876	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	1.82	0.000980	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	-3.81	-0.002051	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	-11.07	-0.005888	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	-16.25	-0.008644	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	-10.23	-0.005441	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	-12.97	-0.006899	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	-16.69	-0.008878	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	-12.56	-0.006602	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	-9.46	-0.004972	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	-10.43	-0.005482	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	-5.46	-0.002870	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	-14.35	-0.007543	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	-11.09	-0.005962	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	-4.96	-0.002667	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	-6.95	-0.003737	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	-5.22	-0.002806	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	-3.23	-0.001737	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-13.09	-0.006963	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-8.30	-0.004415	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band2	20MHz	QPSK	18900	100RB#0	NV	0	-14.33	-0.007622	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	-11.34	-0.006032	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-12.62	-0.006713	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-9.74	-0.005126	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-3.82	-0.002011	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	2.37	0.001247	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-5.06	-0.002663	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-4.15	-0.002184	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	-8.74	-0.004699	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	-6.38	-0.003430	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	-6.91	-0.003715	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	-5.32	-0.002860	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	-7.47	-0.004016	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	-10.10	-0.005372	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	-8.07	-0.004293	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-9.96	-0.005298	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	-13.19	-0.007016	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	-10.87	-0.005782	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-8.25	-0.004342	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-3.86	-0.002032	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-7.78	-0.004095	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	-8.60	-0.004526	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-4.18	-0.002200	±2.5	PASS

---End---

