



20MHz\_15kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.90 dBm

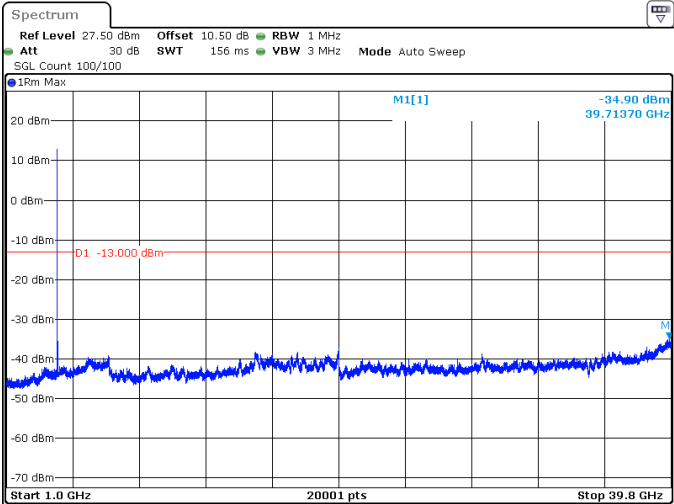


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:11:49

20MHz\_15kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.15 dBm

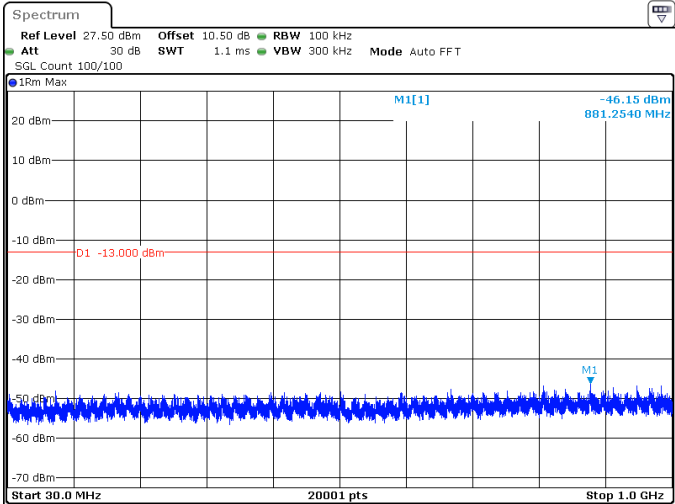


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:10:46

20MHz\_15kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB1@105 -35.26 dBm

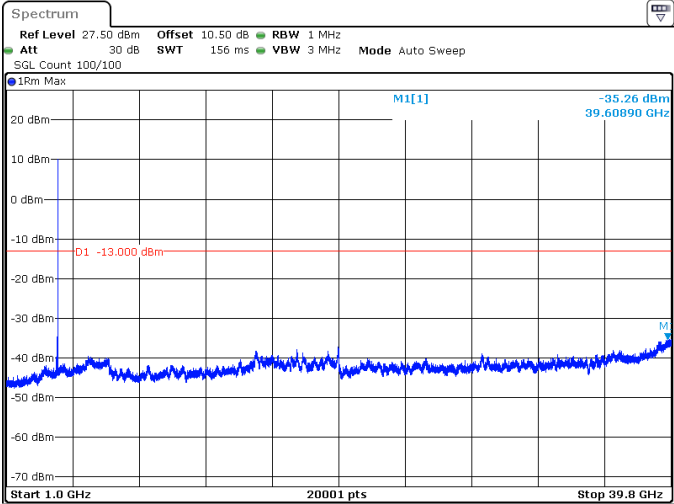


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:13:28

20MHz\_15kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB1@105 -47.07 dBm

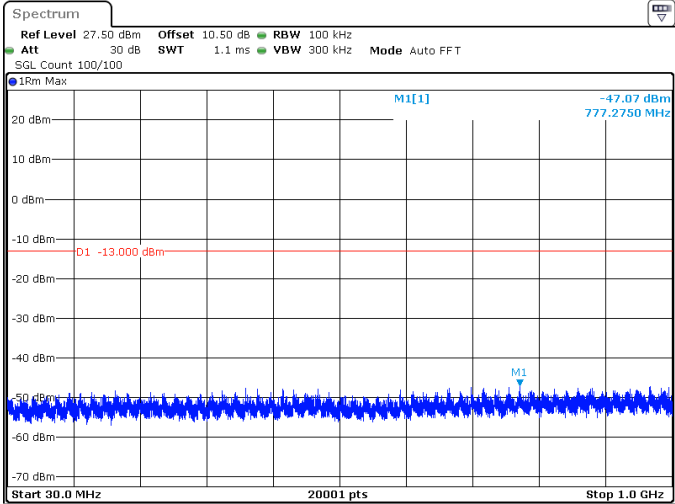


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:12:25

20MHz\_15kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB100@0 -35.24 dBm

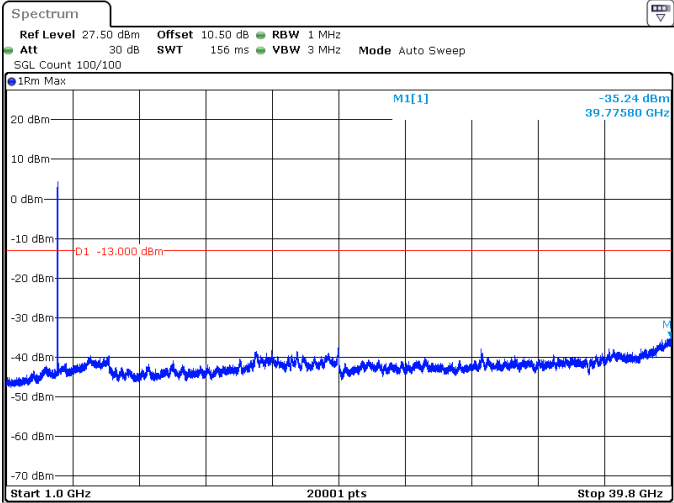


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:15:06

20MHz\_15kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB100@0 -46.65 dBm

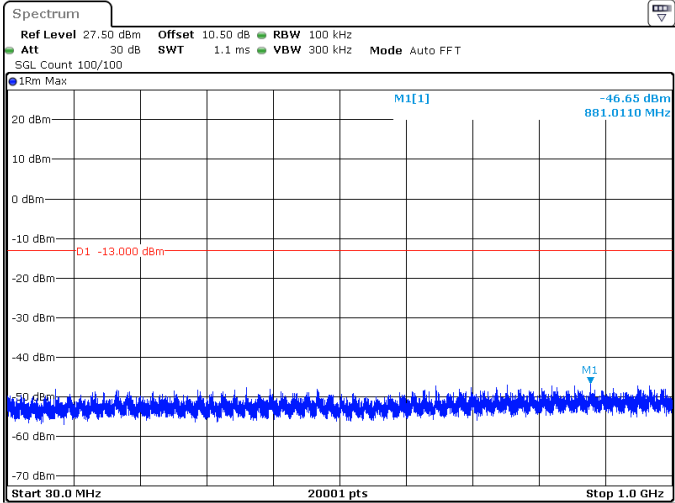


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:14:04

20MHz\_30kHz\_3710MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.23 dBm

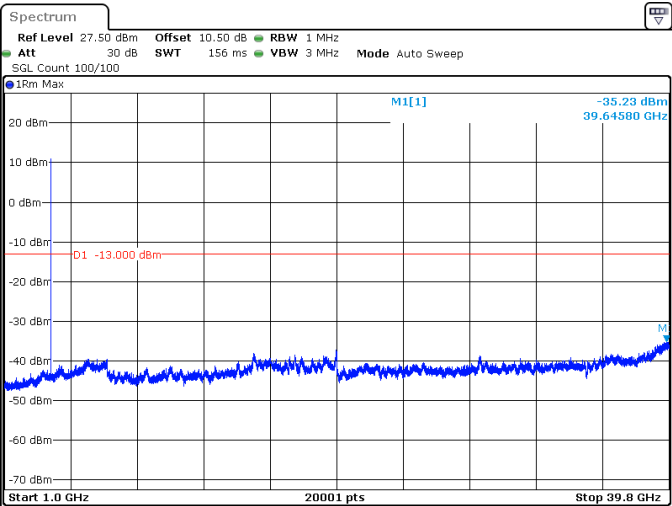


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:16:21

20MHz\_30kHz\_3710MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.70 dBm

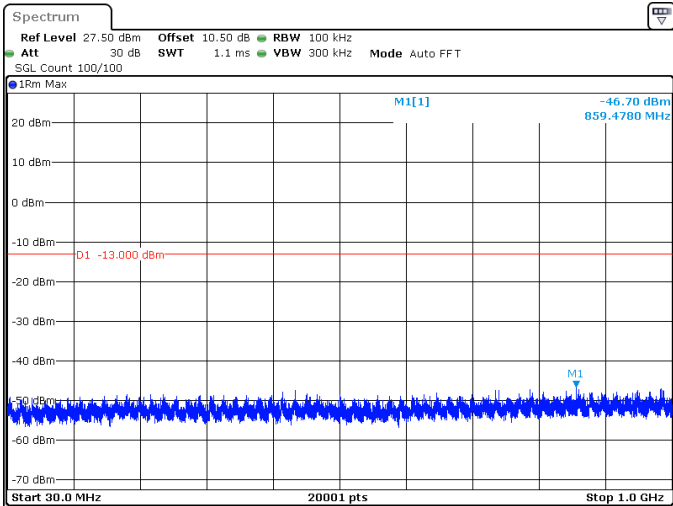


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:15:20

20MHz\_30kHz\_3710MHz\_DFT-s-OFDM QPSK\_RB1@50 -34.83 dBm

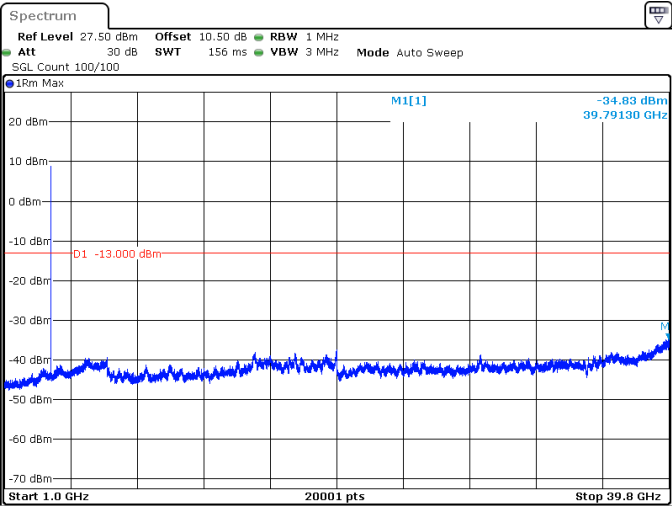


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:17:54

20MHz\_30kHz\_3710MHz\_DFT-s-OFDM QPSK\_RB1@50 -46.76 dBm

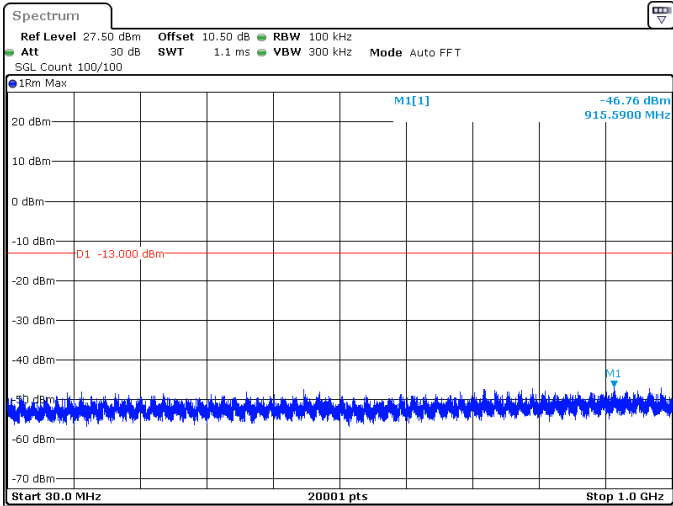


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:16:52

20MHz\_30kHz\_3710MHz\_DFT-s-OFDM QPSK\_RB50@0 -34.99 dBm

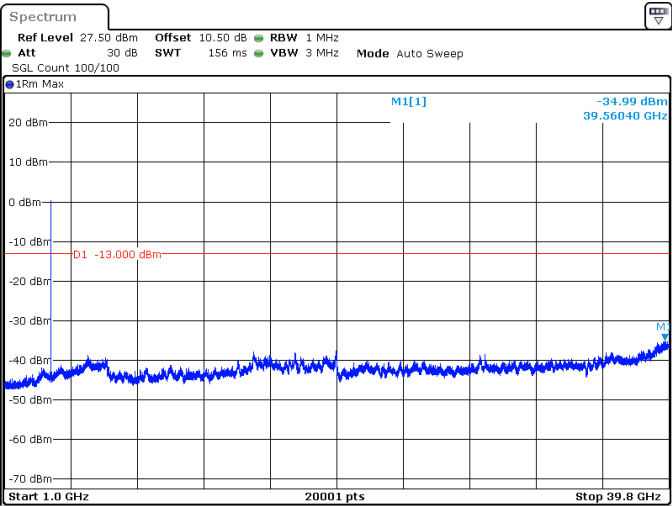


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:19:26

20MHz\_30kHz\_3710MHz\_DFT-s-OFDM QPSK\_RB50@0 -47.15 dBm

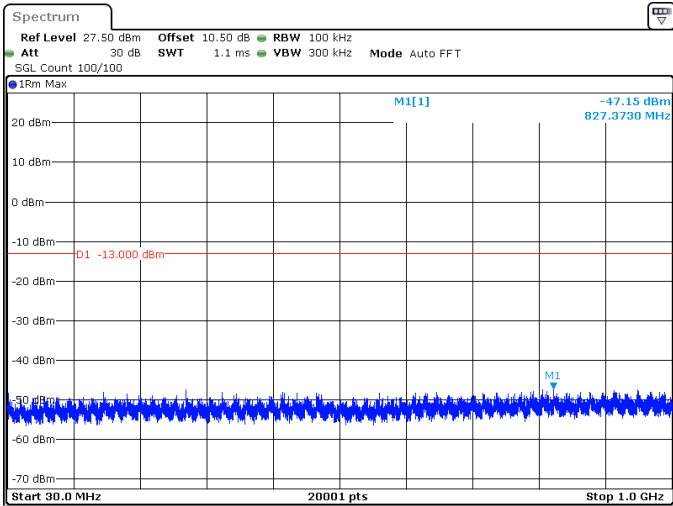


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:18:25

20MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.83 dBm

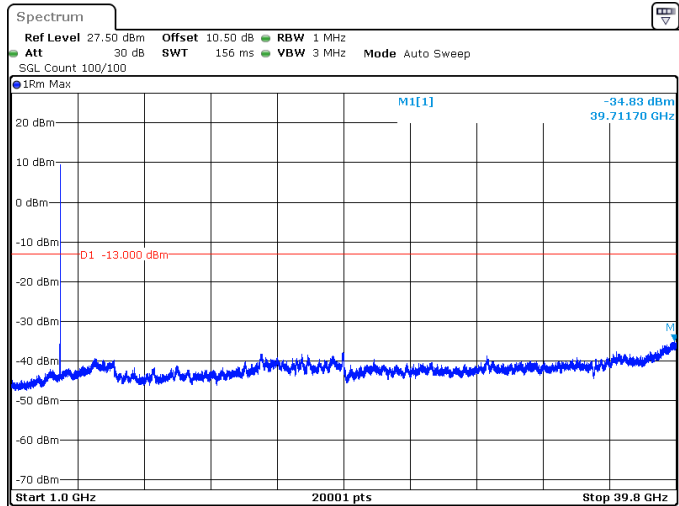


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:21:02

20MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.12 dBm

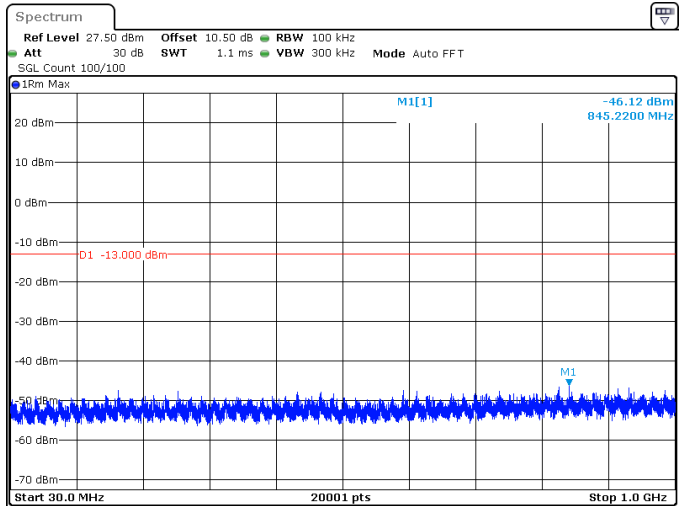


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:20:01

20MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@50 -46.06 dBm

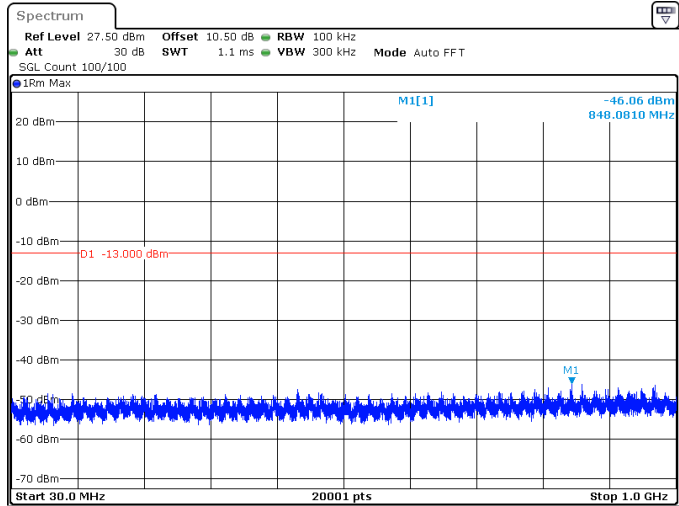


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:21:32

20MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@50 -34.66 dBm

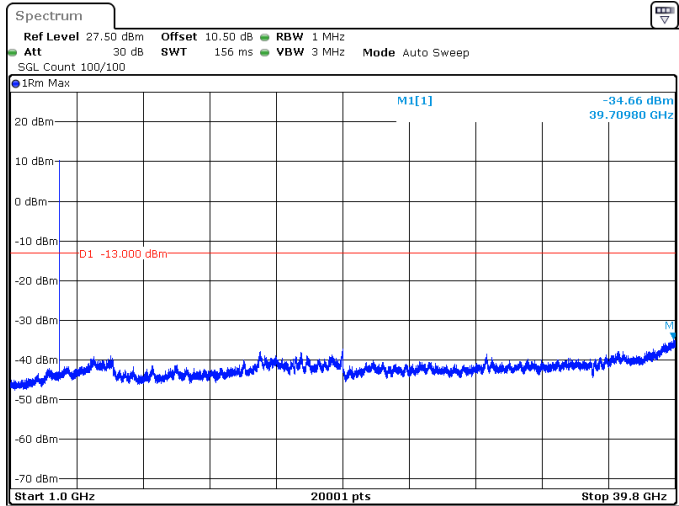


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:22:33

20MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB50@0 -35.32 dBm

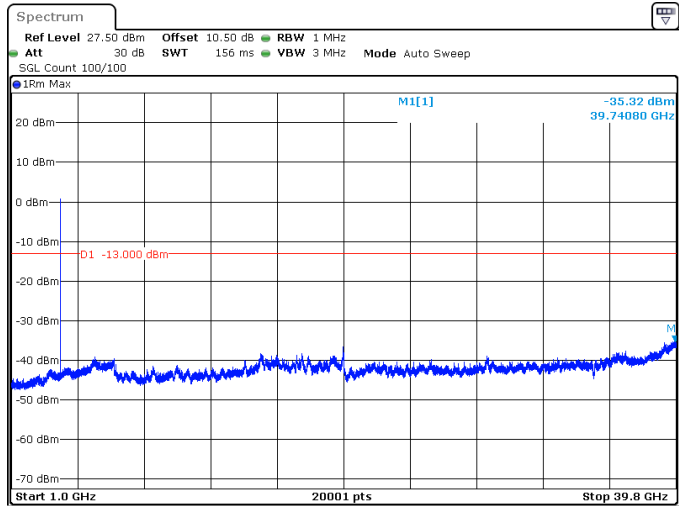


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:24:04

20MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB50@0 -47.06 dBm

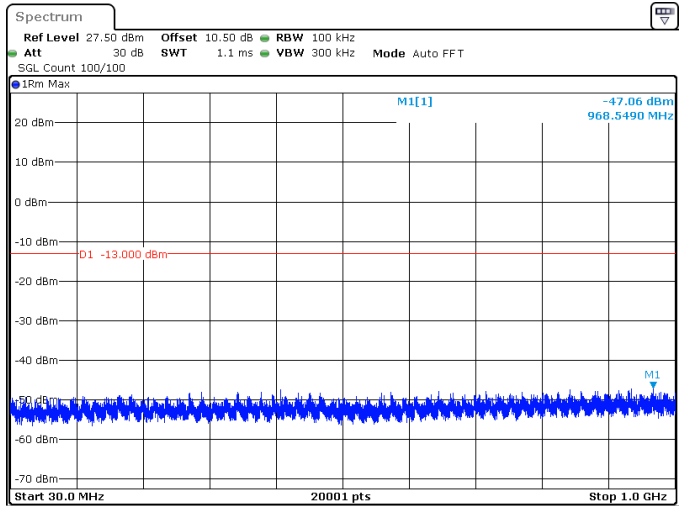


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:23:03

20MHz\_30kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.79 dBm

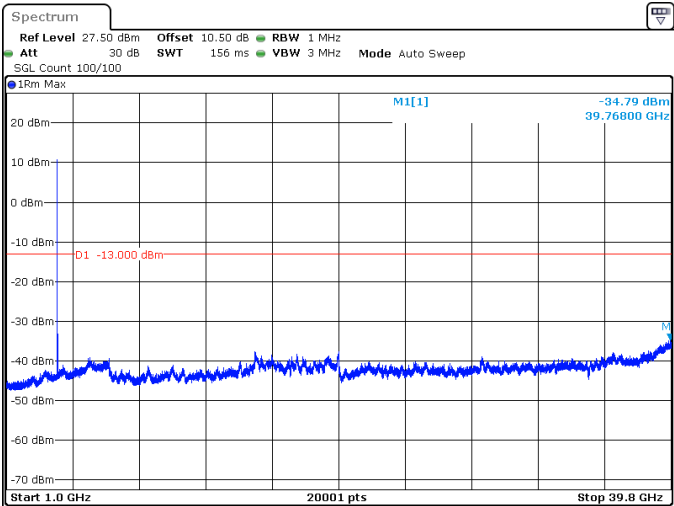


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:25:41

20MHz\_30kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.00 dBm

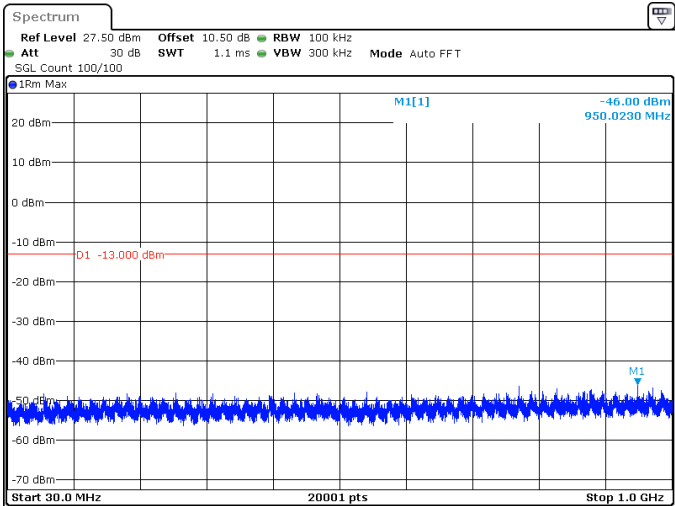


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:24:39

20MHz\_30kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB1@50 -34.68 dBm

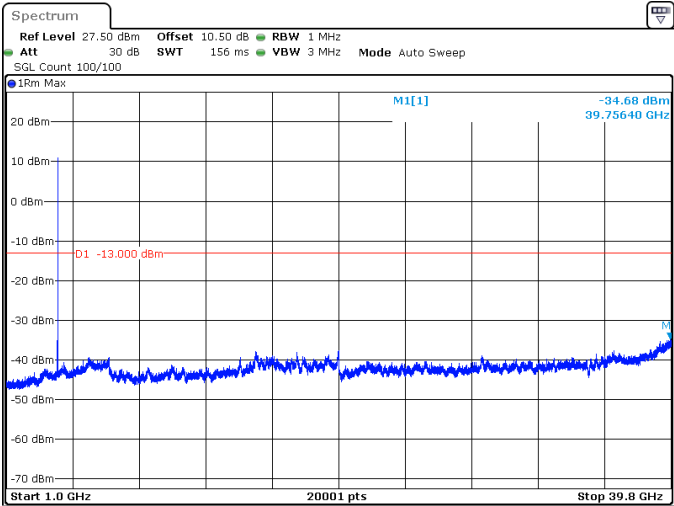


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:27:11

20MHz\_30kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB1@50 -46.75 dBm

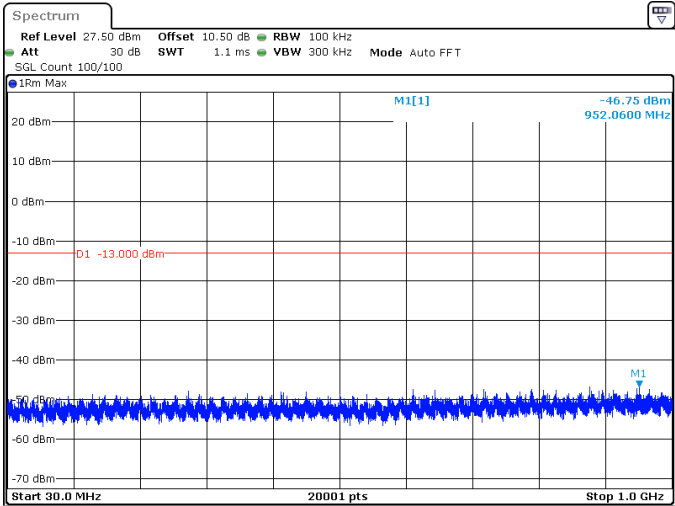


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:26:11

20MHz\_30kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB50@0 -46.33 dBm

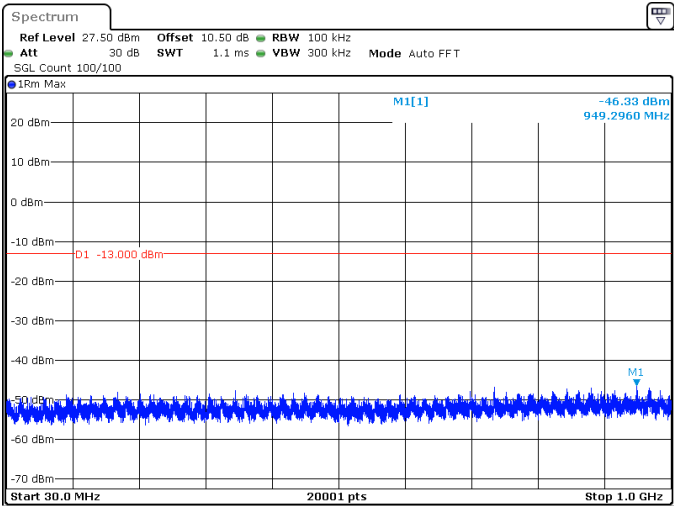


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:27:42

20MHz\_30kHz\_3970MHz\_DFT-s-OFDM QPSK\_RB50@0 -34.87 dBm

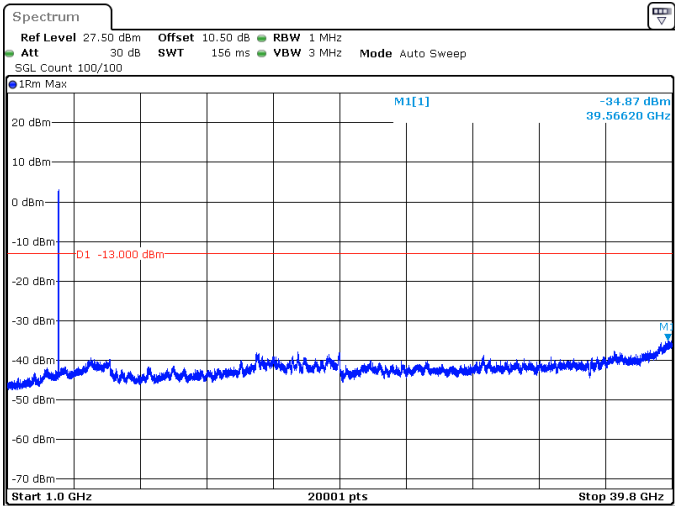


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:28:44

30MHz\_15kHz\_3715MHz\_DFT-s-OFDM QPSK\_RB1@0 -47.15 dBm

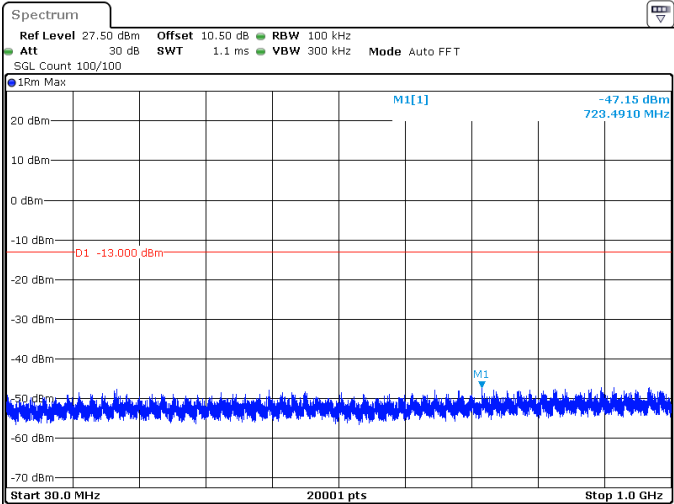


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:15:51

30MHz\_15kHz\_3715MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.36 dBm

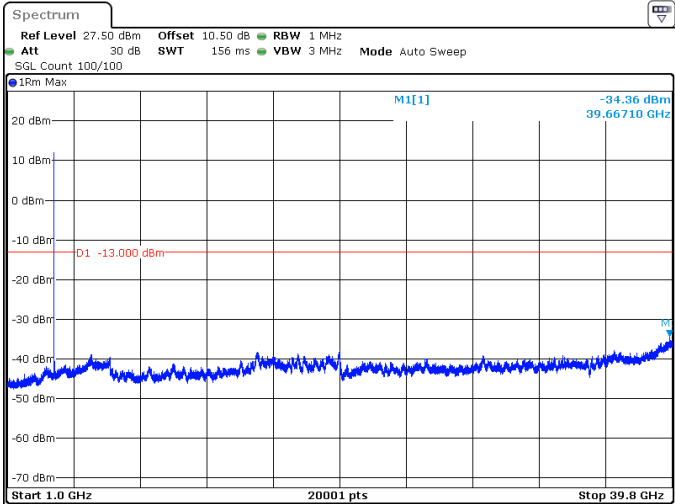


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:16:54

30MHz\_15kHz\_3715MHz\_DFT-s-OFDM QPSK\_RB1@159 -34.77 dBm

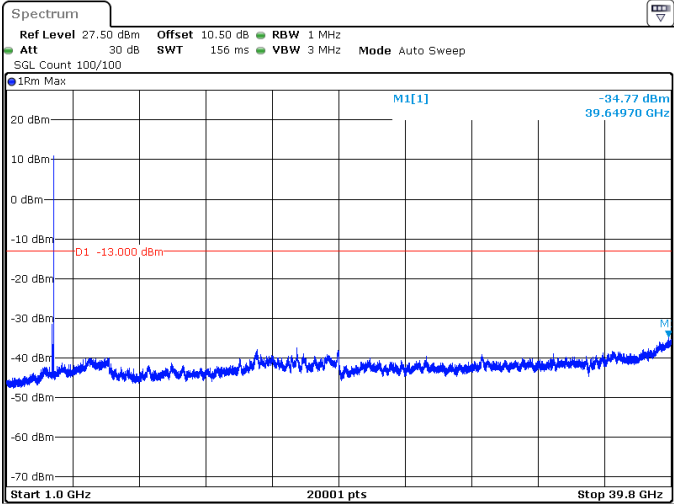


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:18:47

30MHz\_15kHz\_3715MHz\_DFT-s-OFDM QPSK\_RB1@159 -46.77 dBm

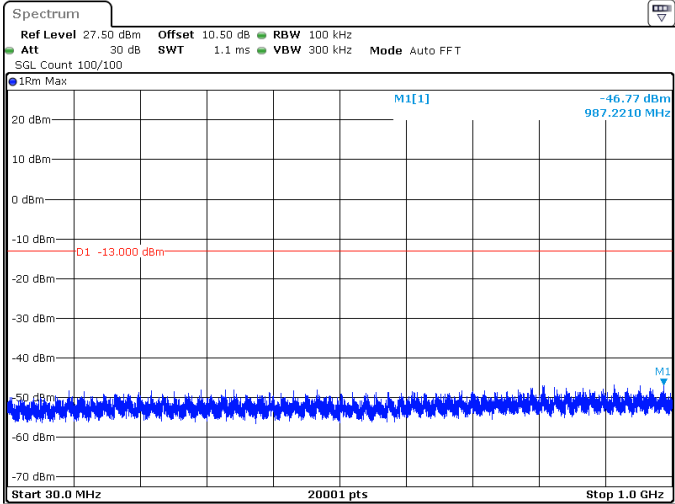


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:17:38

30MHz\_15kHz\_3715MHz\_DFT-s-OFDM QPSK\_RB160@0 -35.21 dBm

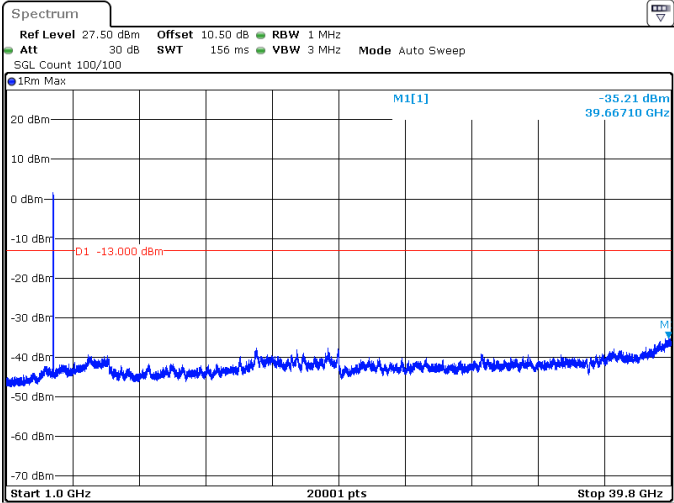


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:20:43

30MHz\_15kHz\_3715MHz\_DFT-s-OFDM QPSK\_RB160@0 -46.84 dBm

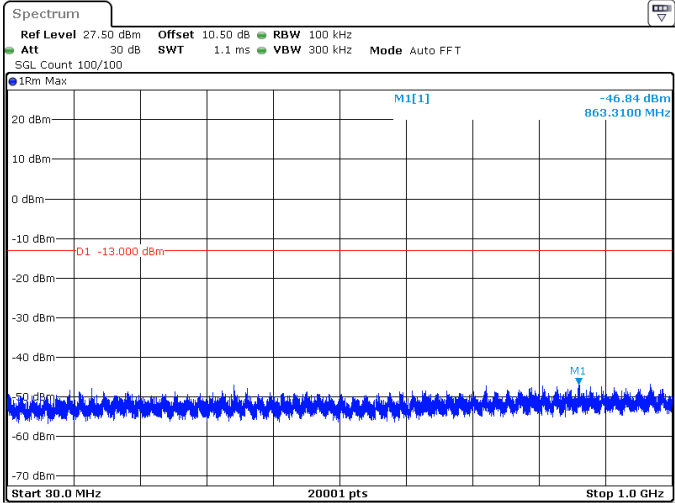


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:19:36

30MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.38 dBm

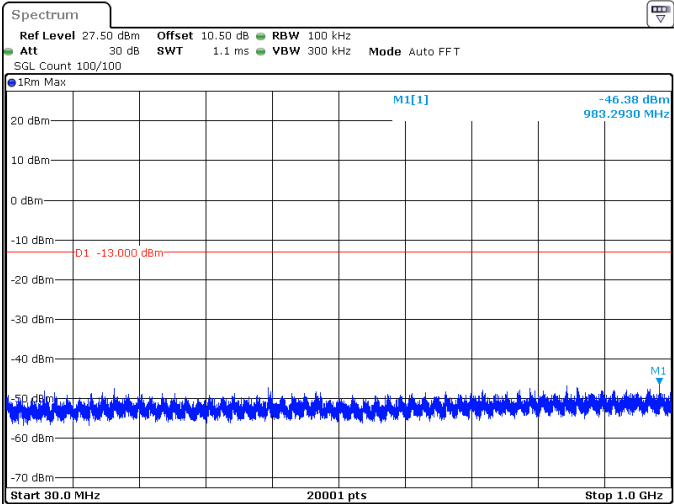


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:21:38

30MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.65 dBm

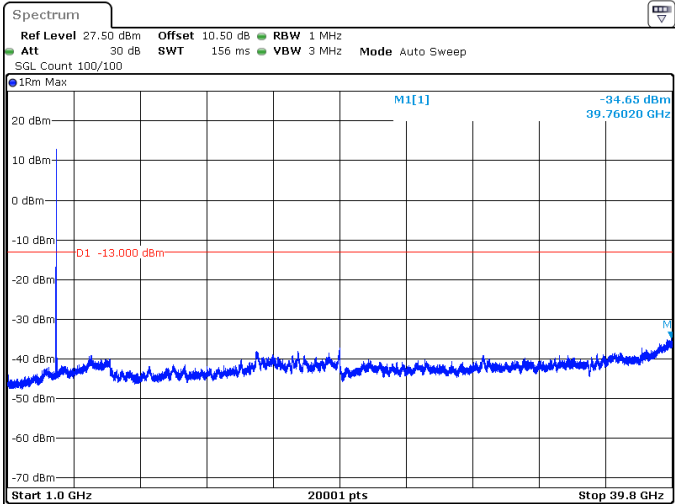


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:22:44

30MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@159 -46.01 dBm

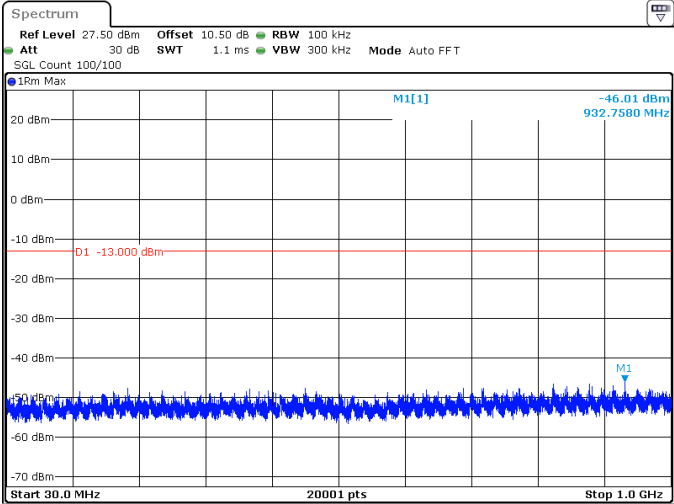


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:23:33

30MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@159 -35.13 dBm

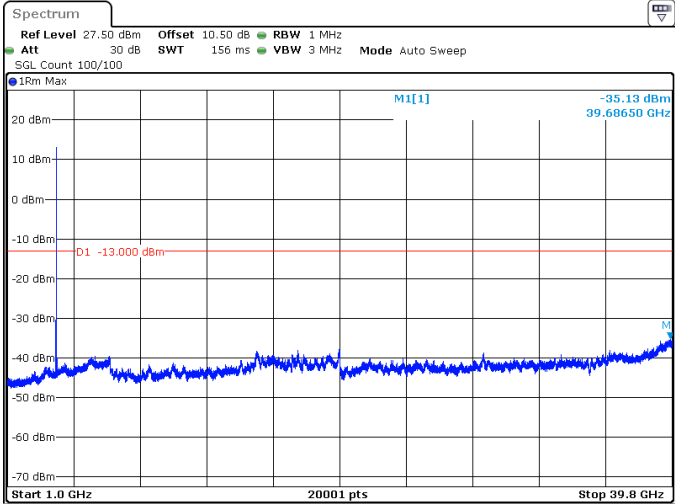


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:24:43

30MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB160@0 -46.55 dBm

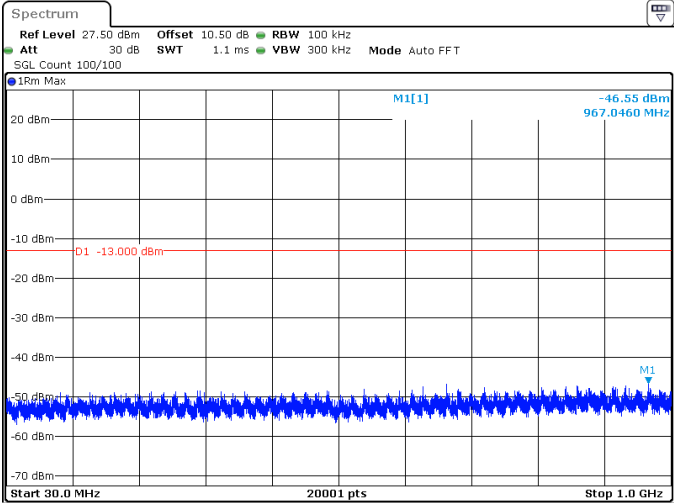


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:25:31

30MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB160@0 -35.22 dBm

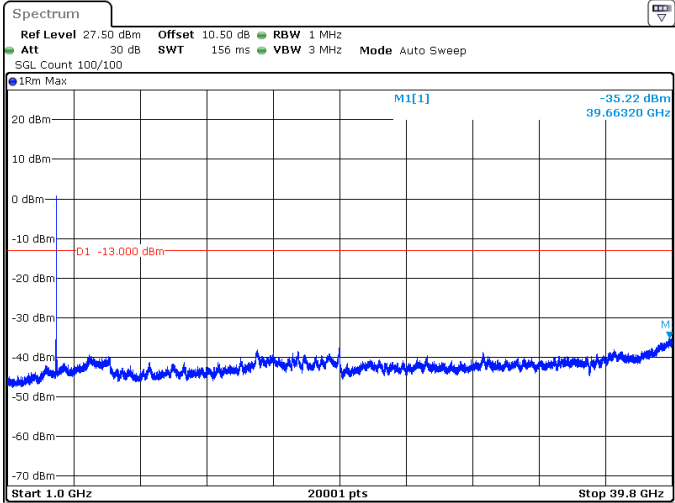


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:26:41

30MHz\_15kHz\_3965MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.63 dBm

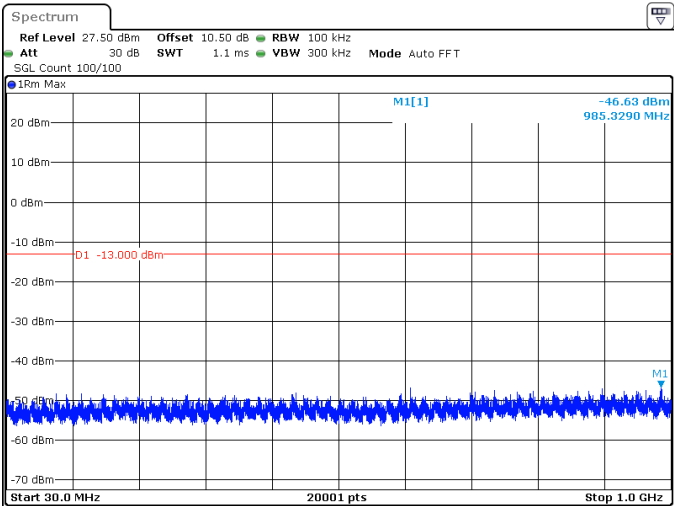


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:27:54

30MHz\_15kHz\_3965MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.83 dBm

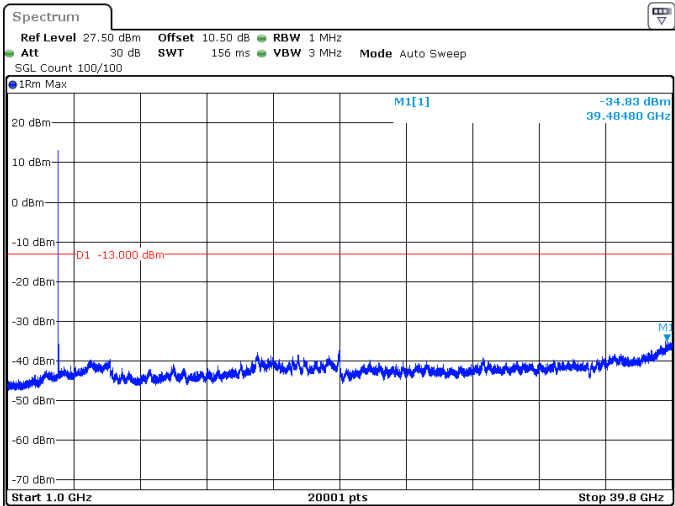


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:29:07

30MHz\_15kHz\_3965MHz\_DFT-s-OFDM QPSK\_RB1@159 -47.20 dBm

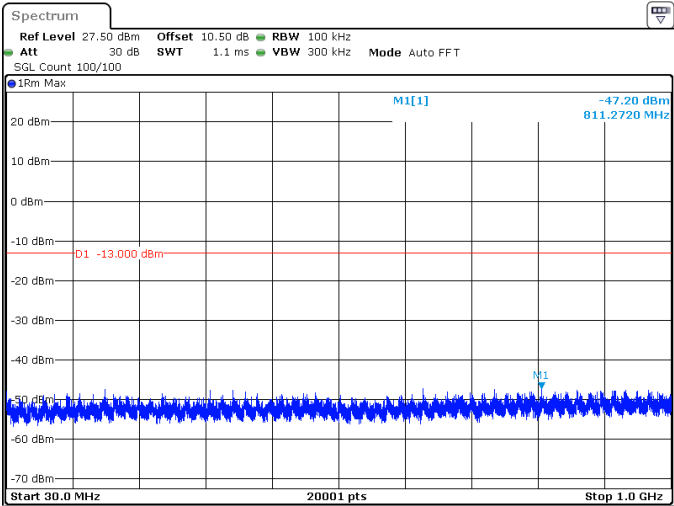


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:30:12

30MHz\_15kHz\_3965MHz\_DFT-s-OFDM QPSK\_RB1@159 -35.11 dBm

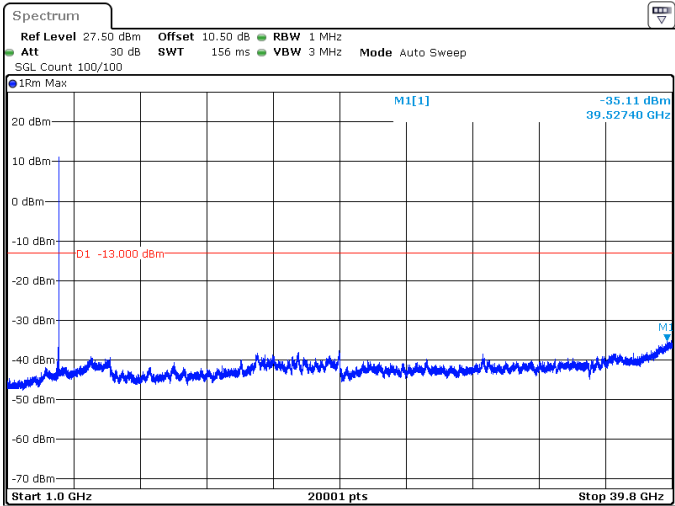


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:31:24

30MHz\_15kHz\_3965MHz\_DFT-s-OFDM QPSK\_RB160@0 -34.88 dBm

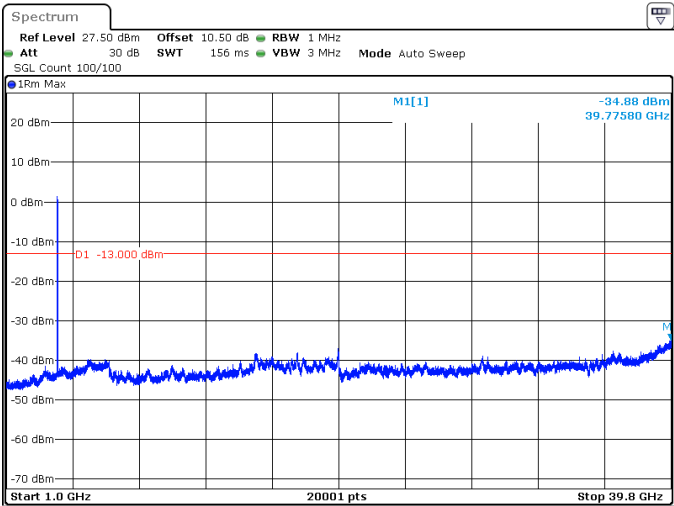


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:33:23

30MHz\_15kHz\_3965MHz\_DFT-s-OFDM QPSK\_RB160@0 -46.72 dBm

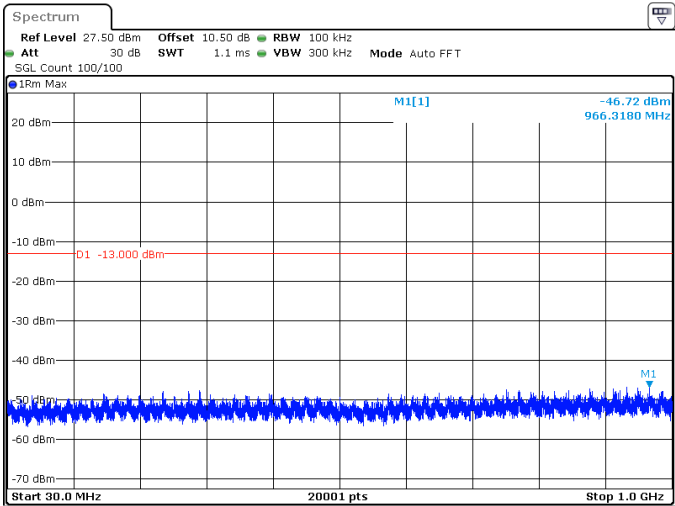


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:32:21

40MHz\_15kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.17 dBm

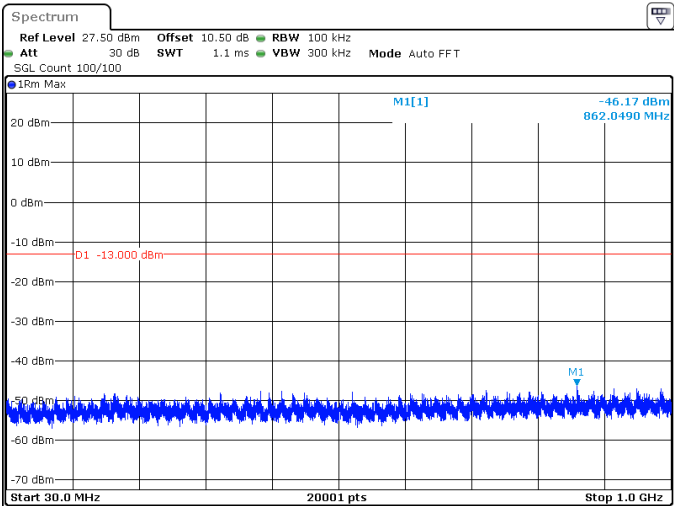


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:34:07

40MHz\_15kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.82 dBm

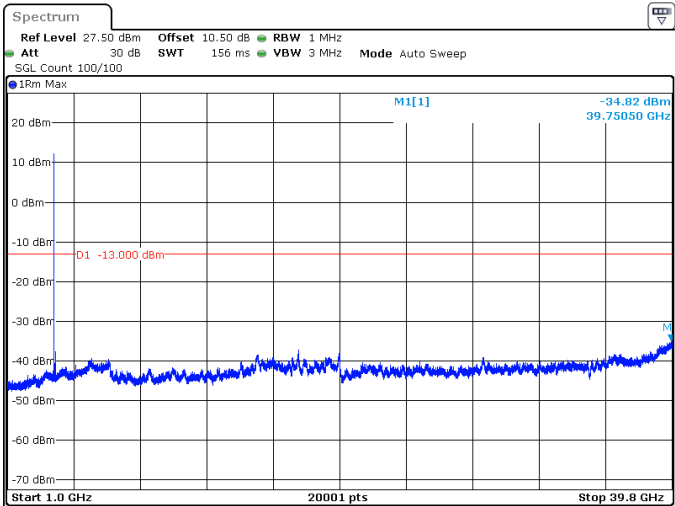


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:35:09

40MHz\_15kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB1@215 -46.75 dBm

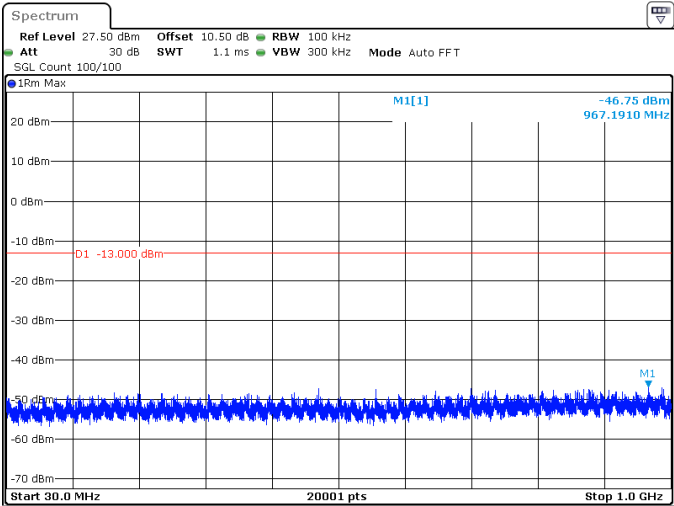


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:35:48

40MHz\_15kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB1@215 -35.41 dBm

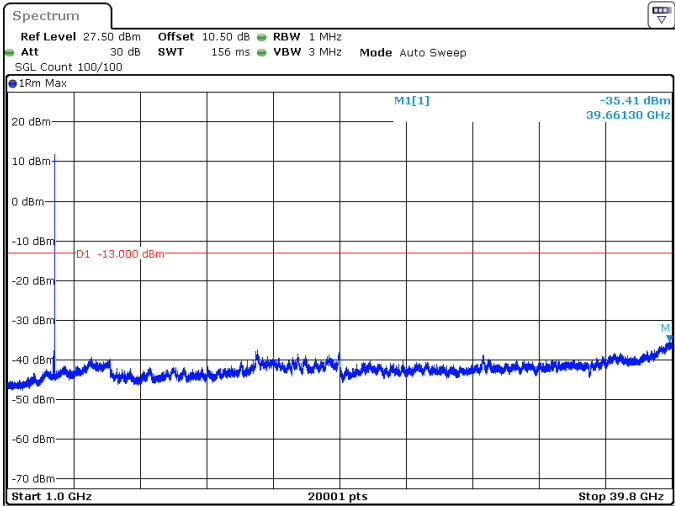


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:36:50

40MHz\_15kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB216@0 -35.18 dBm

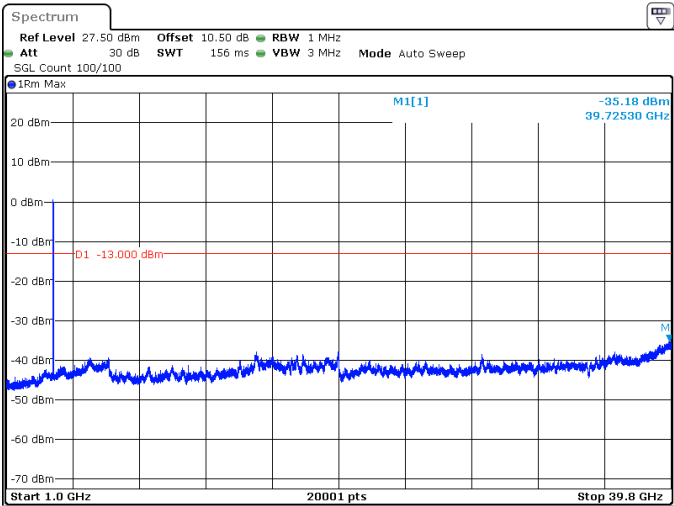


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:38:30

40MHz\_15kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB216@0 -46.59 dBm

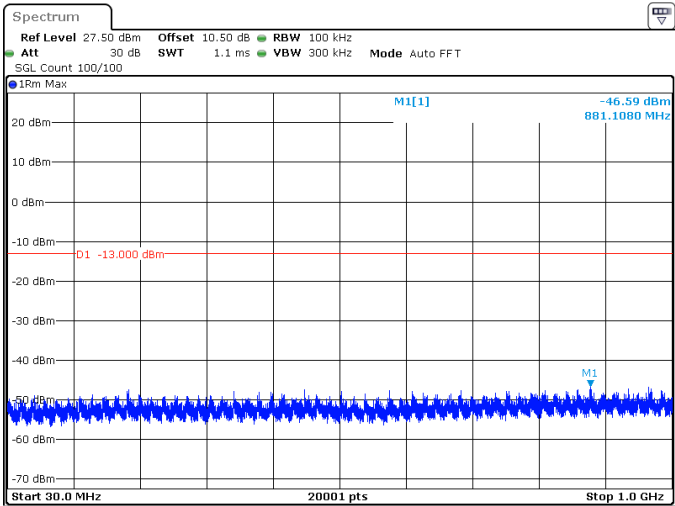


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:37:28

40MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.95 dBm

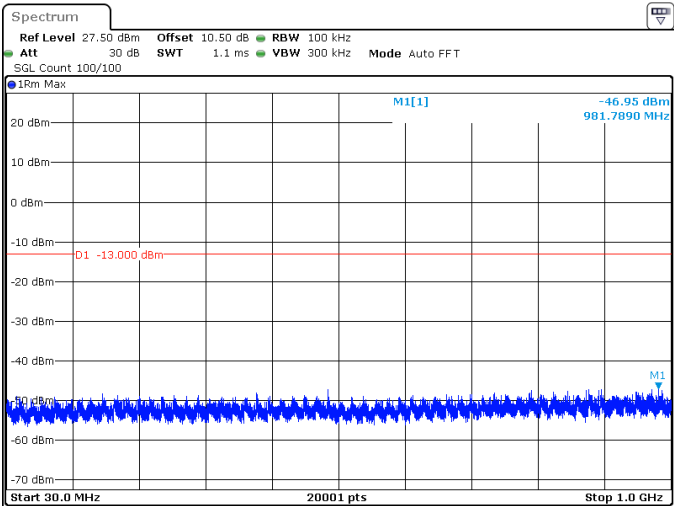


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:39:24

40MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.55 dBm

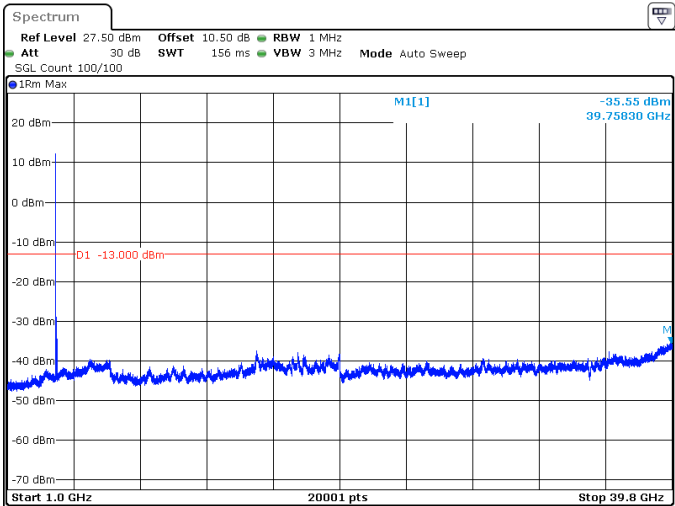


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:40:27

40MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@215 -46.82 dBm

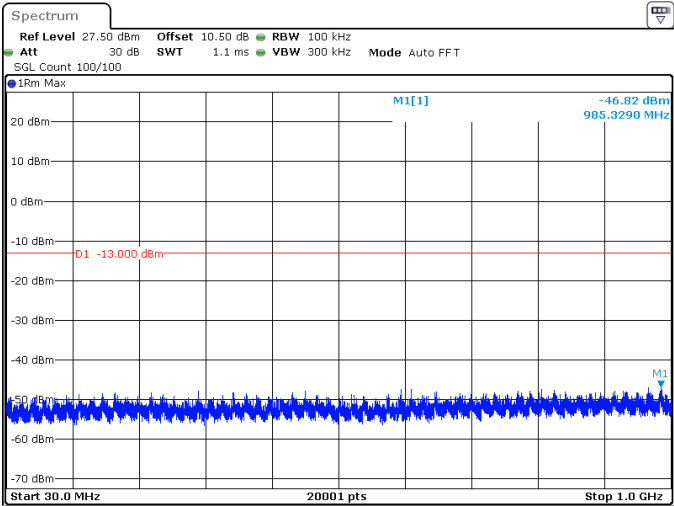


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:41:04

40MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@215 -34.91 dBm

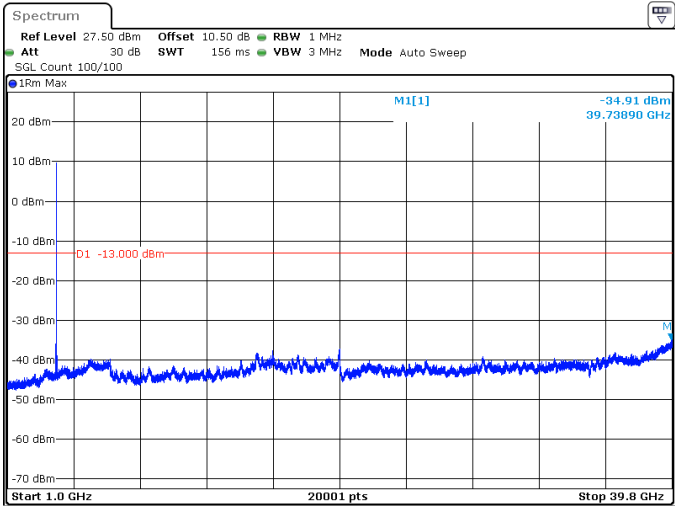


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:42:06

40MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB216@0 -45.02 dBm

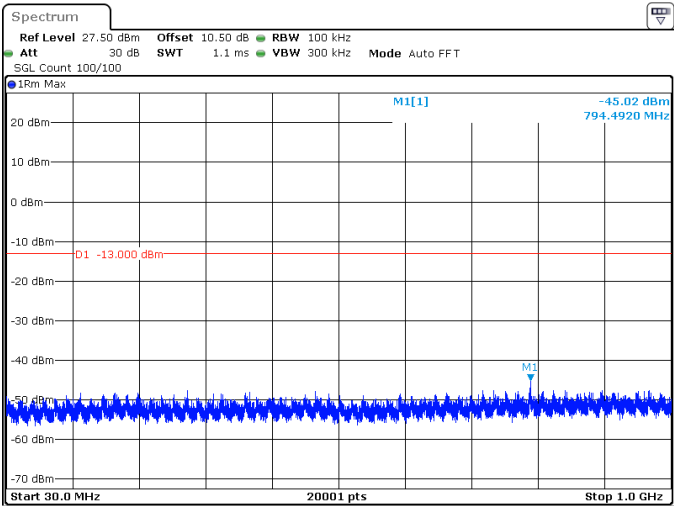


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:42:44

40MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB216@0 -34.27 dBm

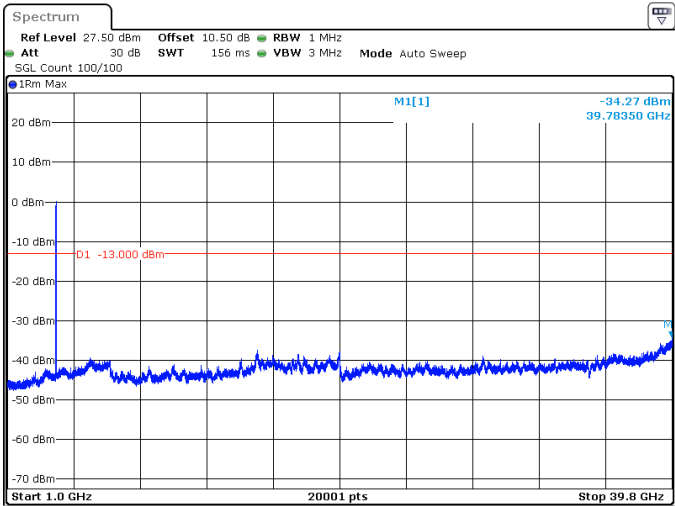


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:43:48

40MHz\_15kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.50 dBm

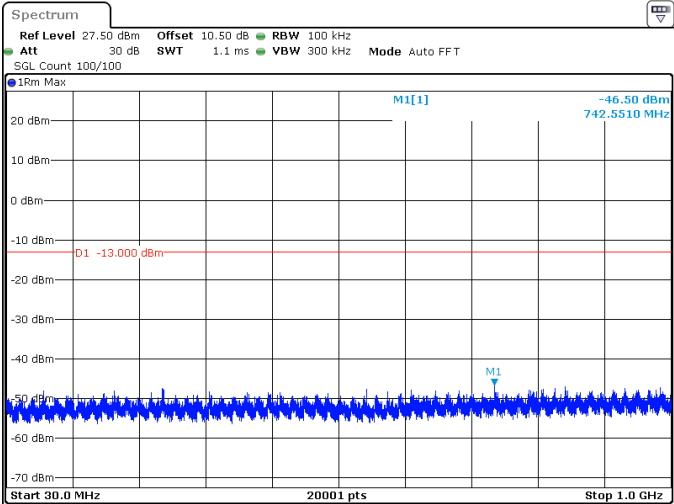


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:44:56

40MHz\_15kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.32 dBm

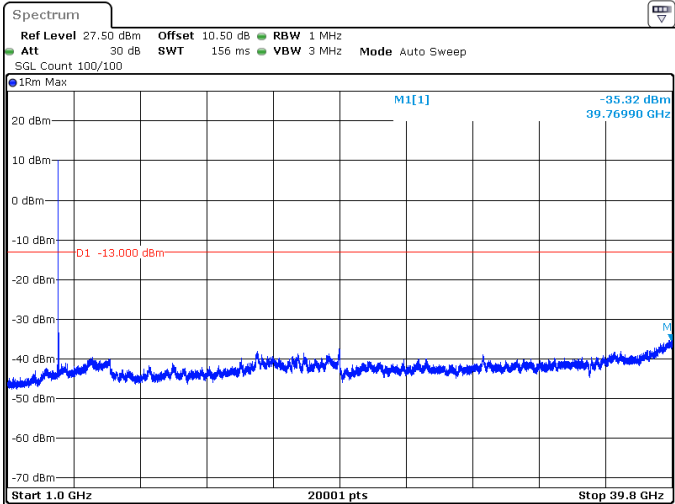


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:46:07

40MHz\_15kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB1@215 -46.76 dBm

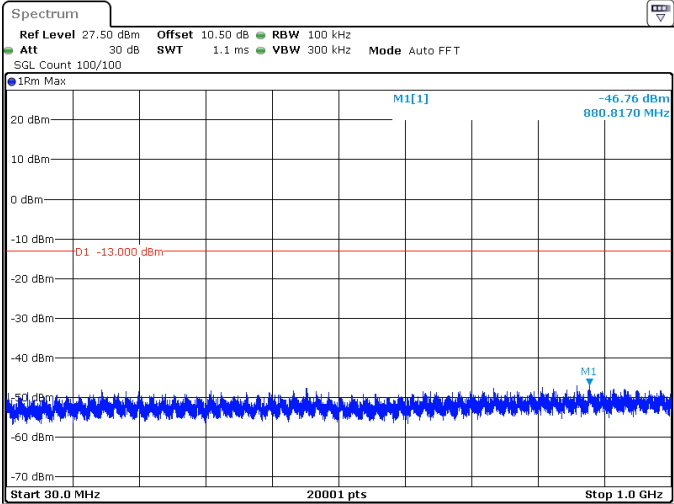


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:47:03

40MHz\_15kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB1@215 -34.62 dBm

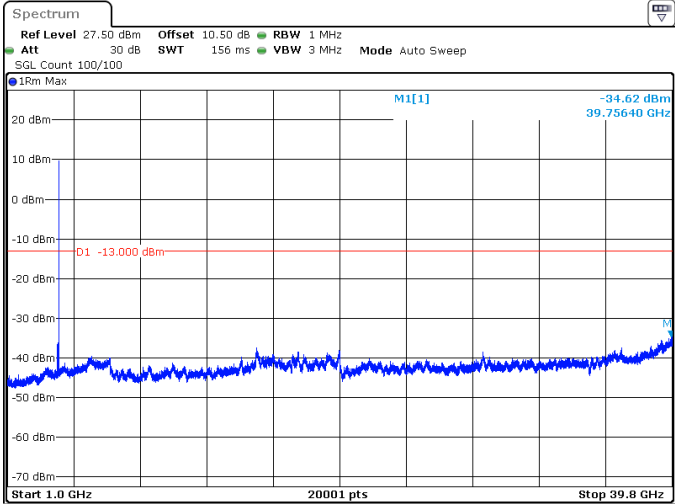


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:48:12

40MHz\_15kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB216@0 -35.19 dBm

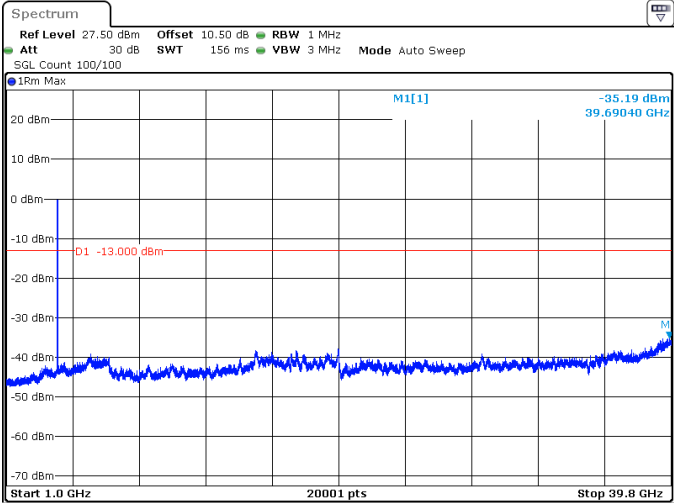


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:50:17

40MHz\_15kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB216@0 -46.60 dBm

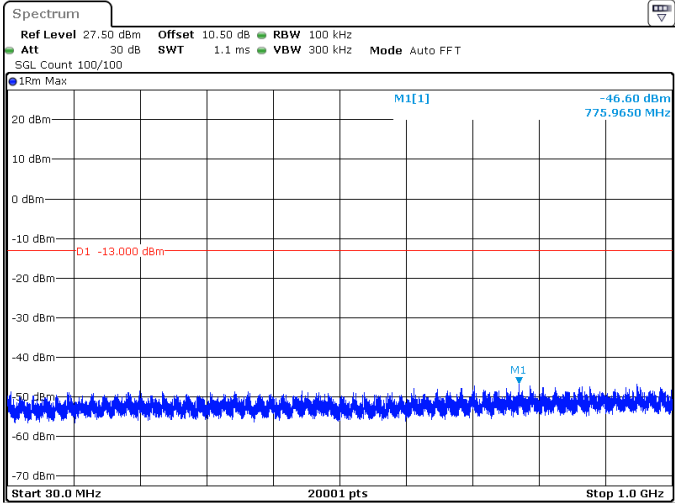


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:49:09

40MHz\_30kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.74 dBm

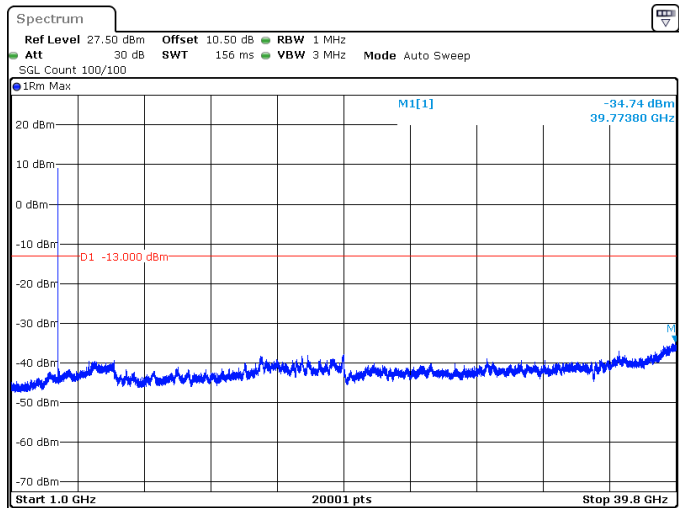


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:30:24

40MHz\_30kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB1@0 -45.78 dBm

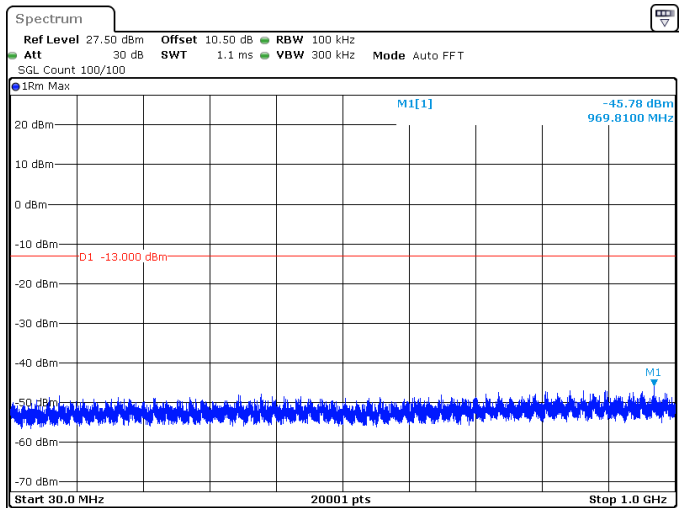


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:29:23

40MHz\_30kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB1@105 -46.09 dBm

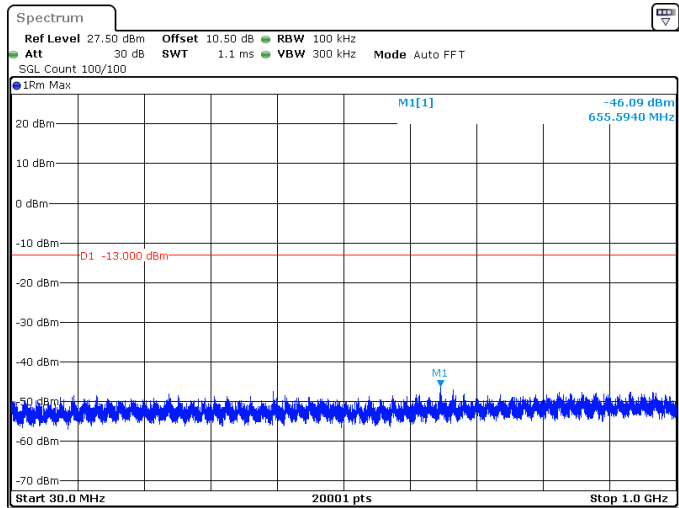


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:30:55

40MHz\_30kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB1@105 -34.58 dBm

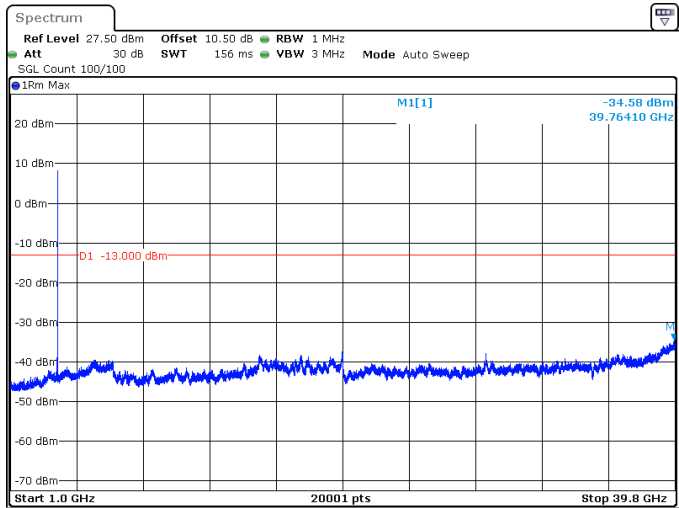


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:31:55

40MHz\_30kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB100@0 -46.61 dBm

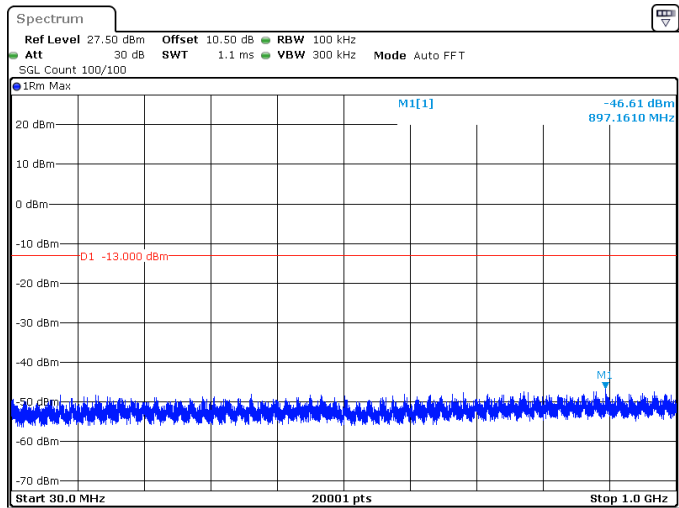


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:32:26

40MHz\_30kHz\_3720MHz\_DFT-s-OFDM QPSK\_RB100@0 -34.68 dBm

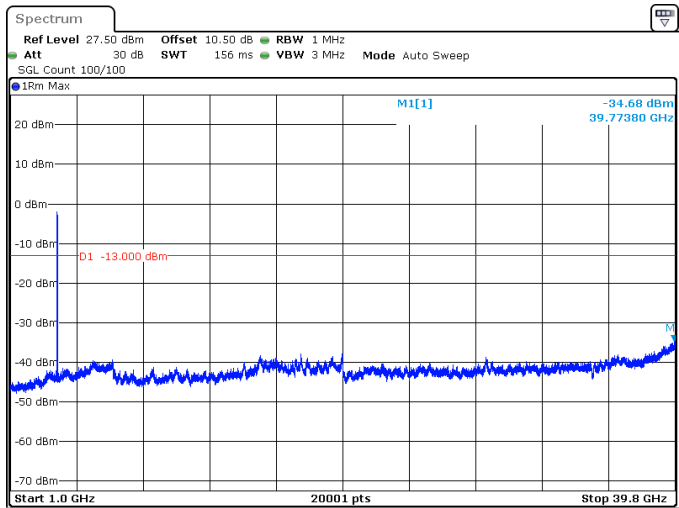


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:33:26

40MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.61 dBm

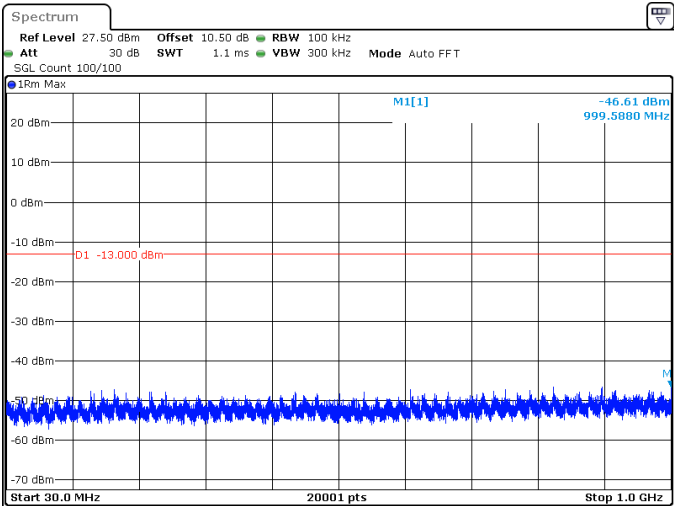


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:34:04

40MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.90 dBm

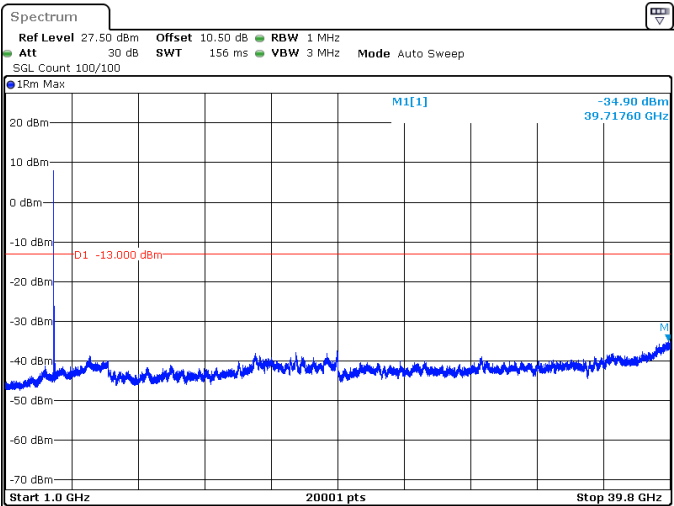


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:35:05

40MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@105 -46.66 dBm

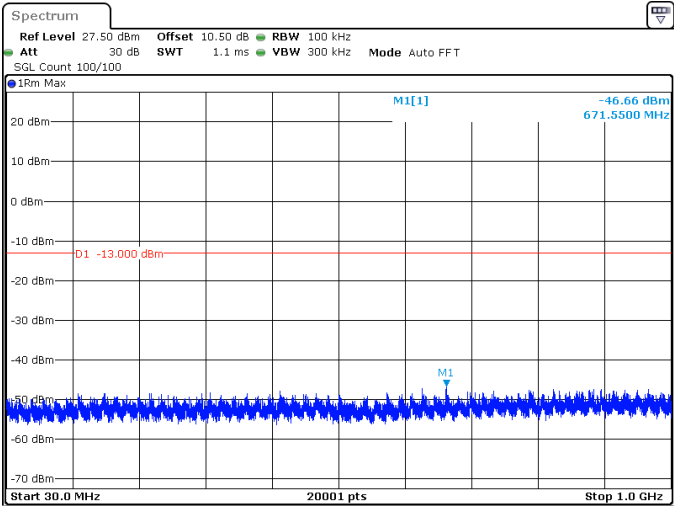


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:35:37

40MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@105 -35.12 dBm

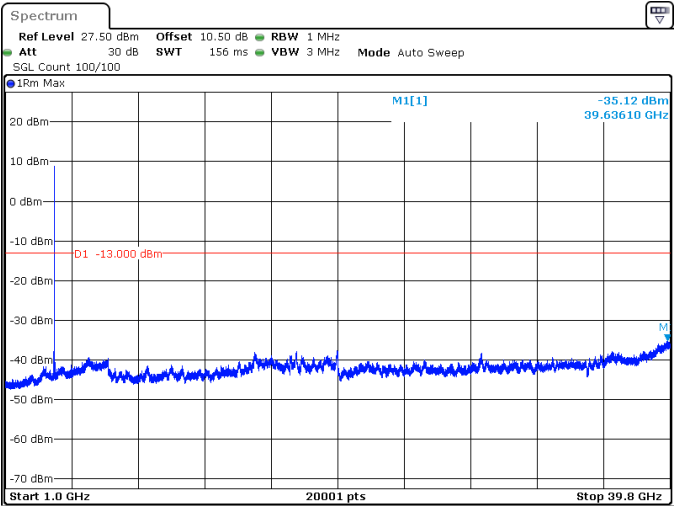


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:36:37

40MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB100@0 -46.82 dBm

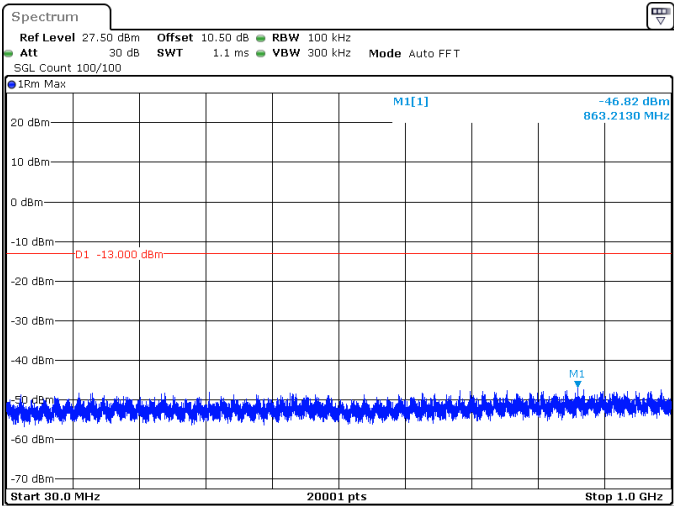


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:38:42

40MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB100@0 -34.83 dBm

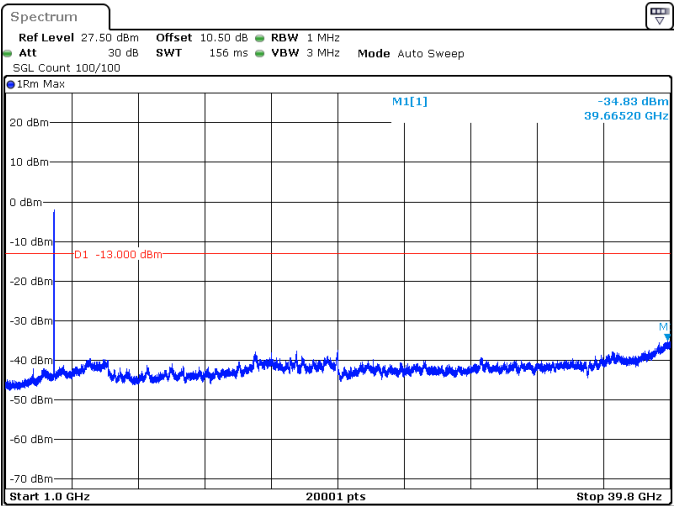


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:40:06

40MHz\_30kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.75 dBm

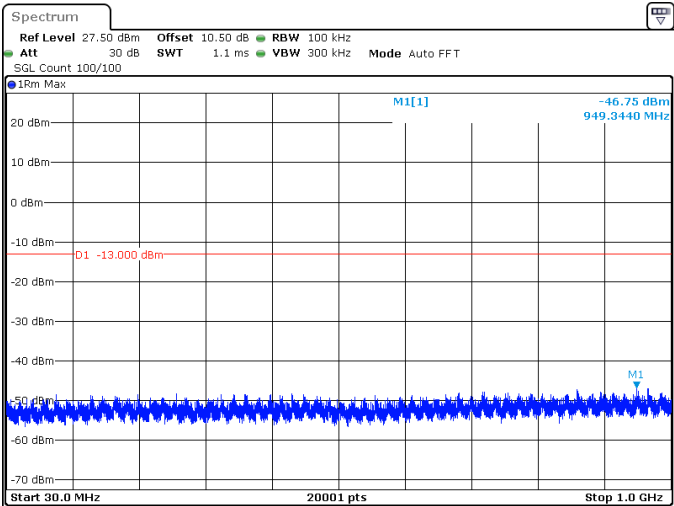


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:41:31

40MHz\_30kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.53 dBm

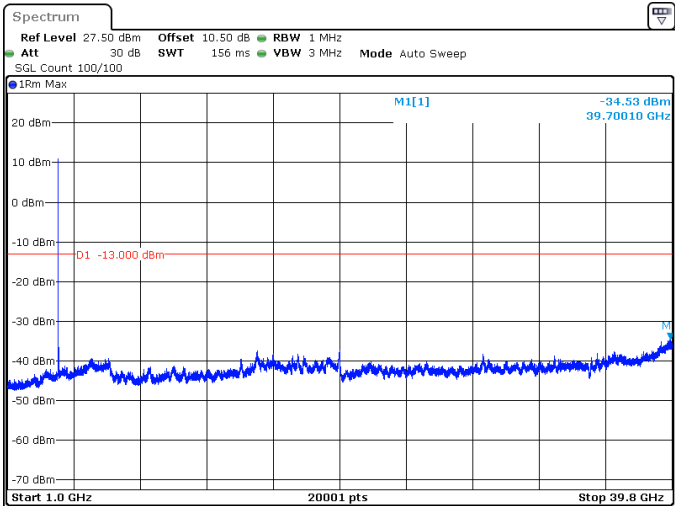


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:42:33

40MHz\_30kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB1@105 -35.04 dBm

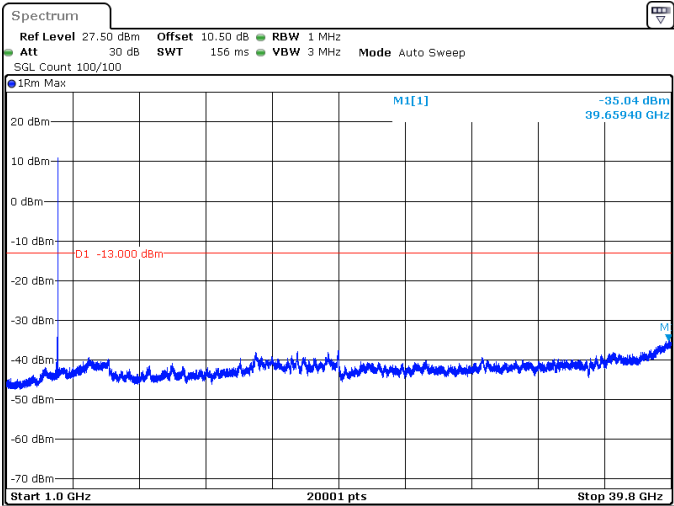


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:44:52

40MHz\_30kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB1@105 -46.62 dBm

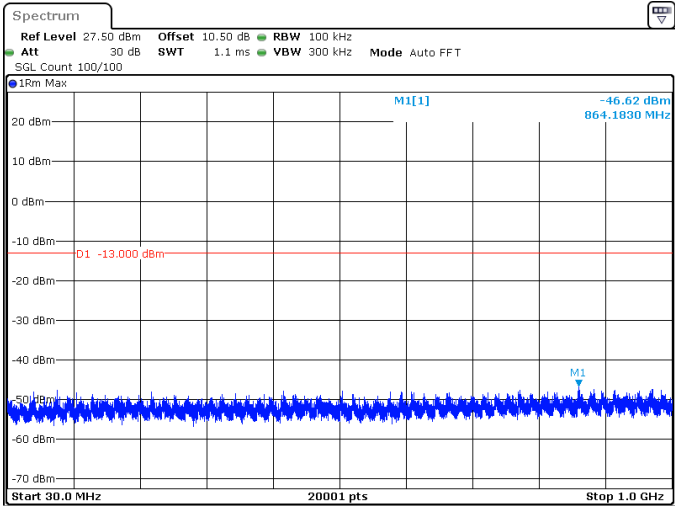


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:43:04

40MHz\_30kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB100@0 -34.82 dBm

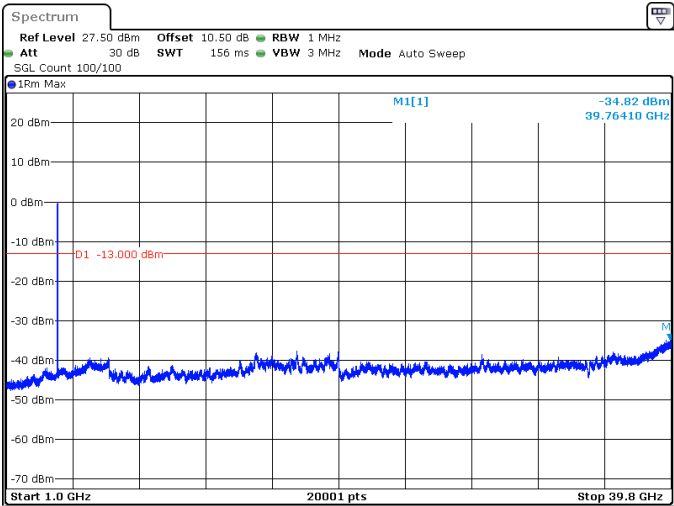


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:46:24

40MHz\_30kHz\_3960MHz\_DFT-s-OFDM QPSK\_RB100@0 -47.31 dBm

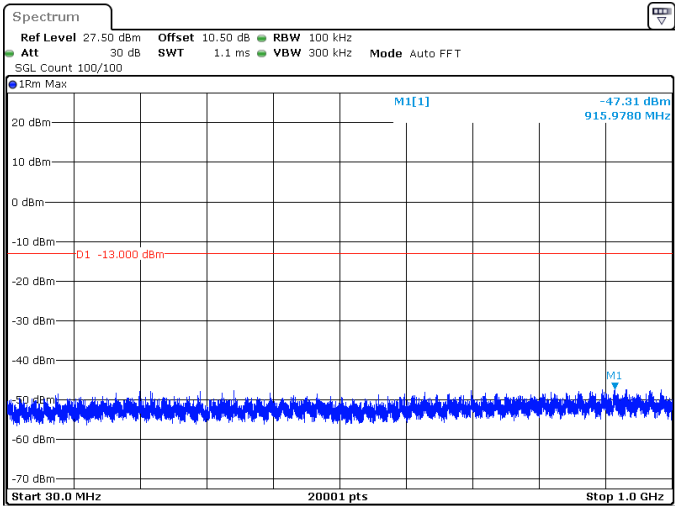


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:45:23

50MHz\_15kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.00 dBm

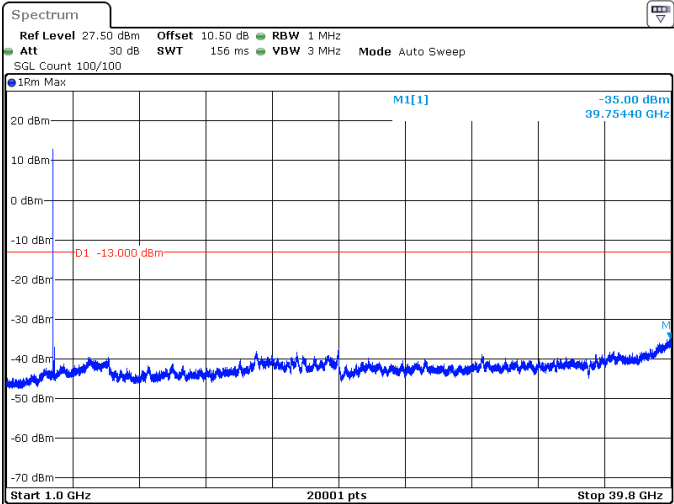


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:52:08

50MHz\_15kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB1@0 -45.58 dBm

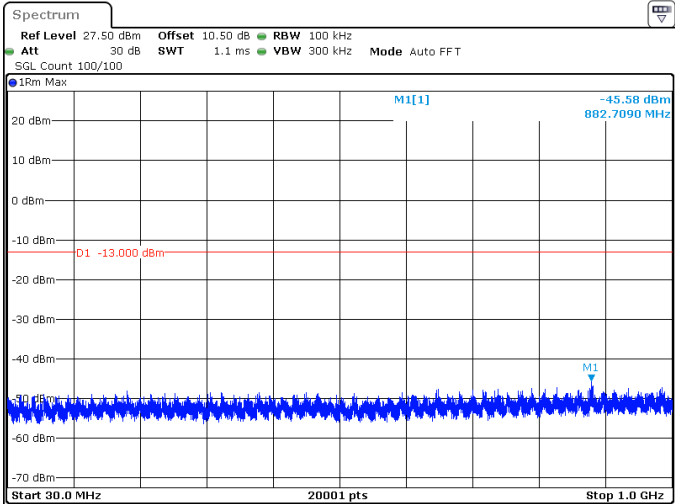


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:51:06

50MHz\_15kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB1@269 -46.78 dBm

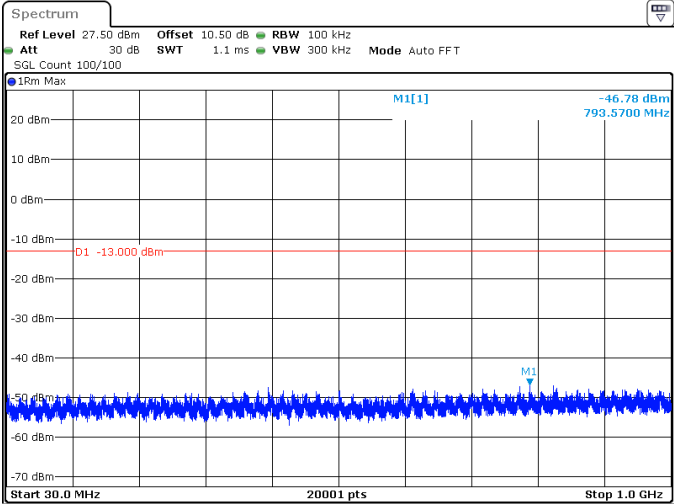


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:52:46

50MHz\_15kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB1@269 -35.21 dBm

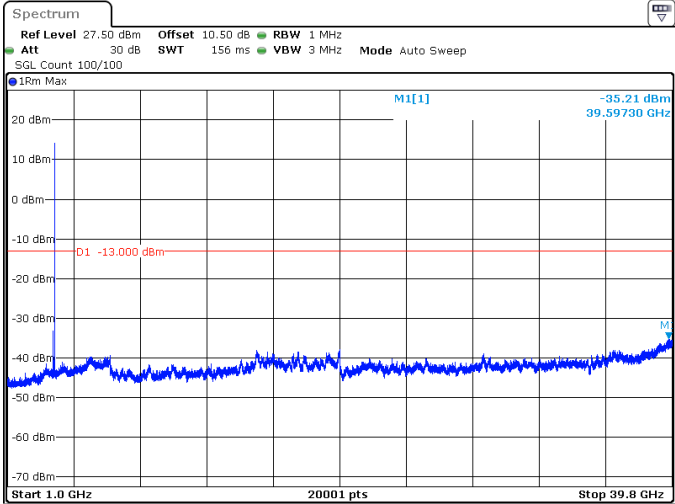


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:53:49

50MHz\_15kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB270@0 -35.12 dBm

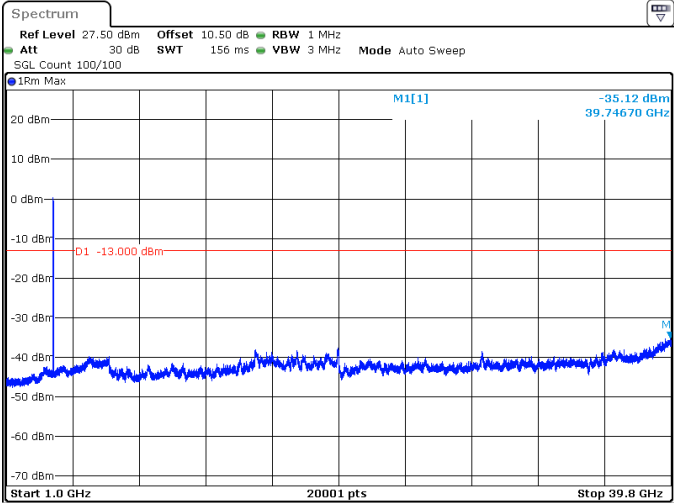


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:55:29

50MHz\_15kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB270@0 -46.24 dBm

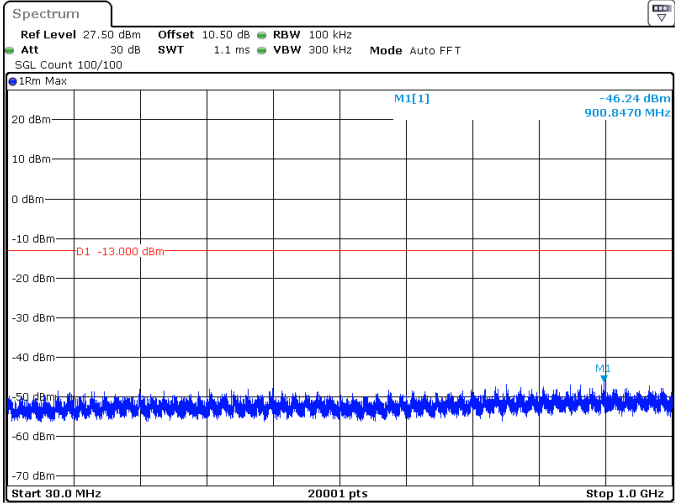


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:54:26

50MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.81 dBm

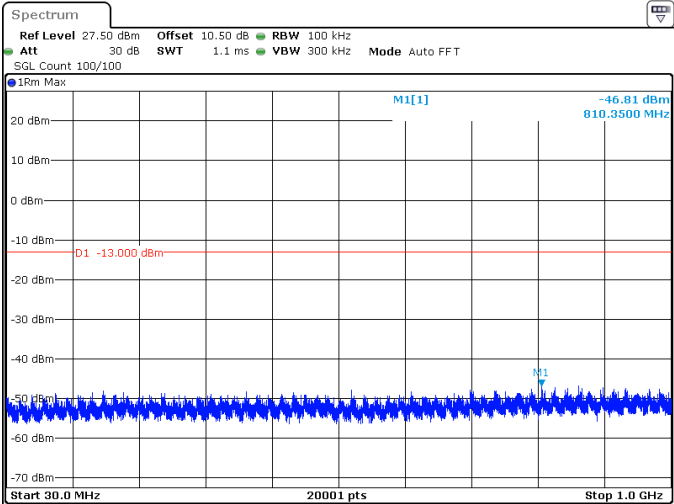


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:56:17

50MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.02 dBm

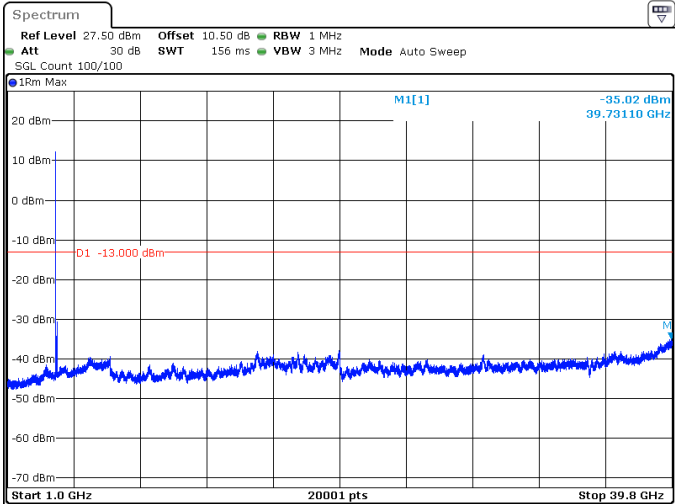


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:57:24

50MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@269 -47.13 dBm

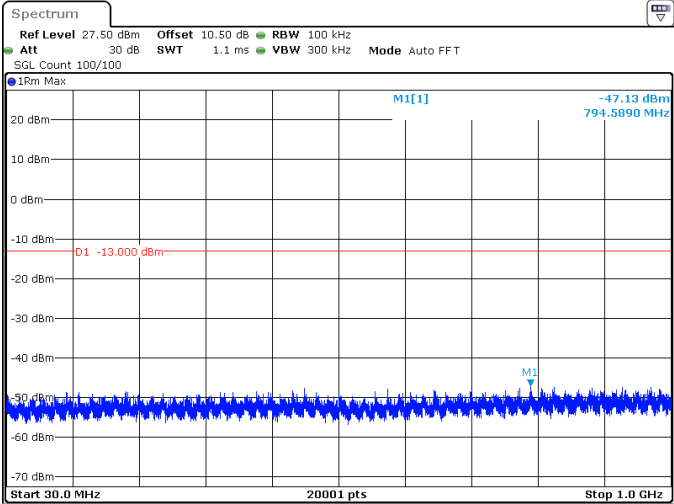


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:58:14

50MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@269 -34.97 dBm

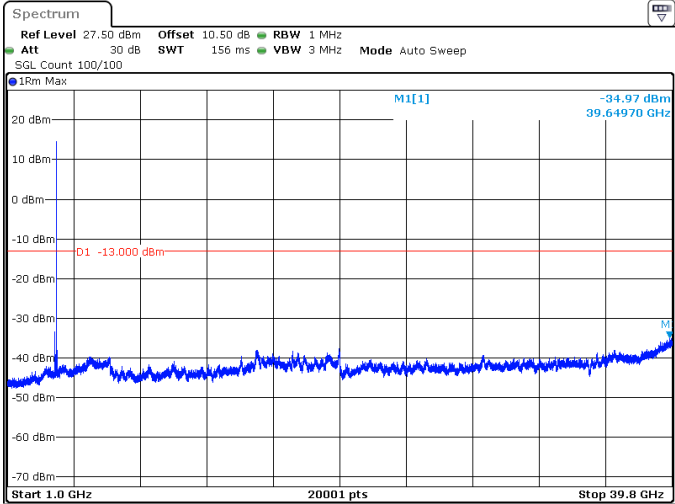


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 16:59:20

50MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB270@0 -47.00 dBm

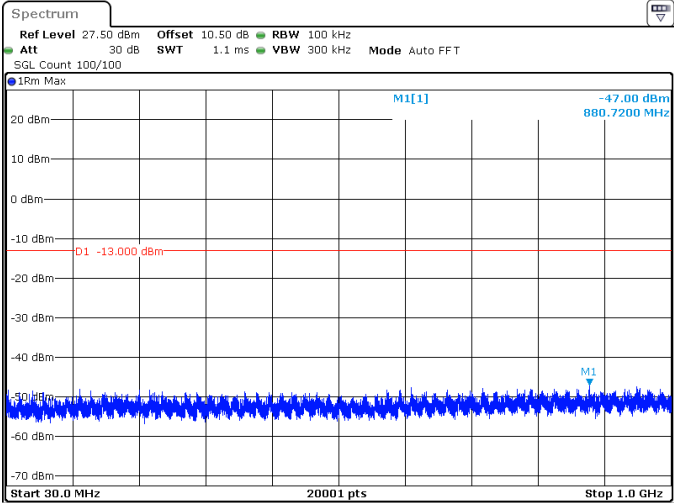


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 17:00:06

50MHz\_15kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB270@0 -35.35 dBm

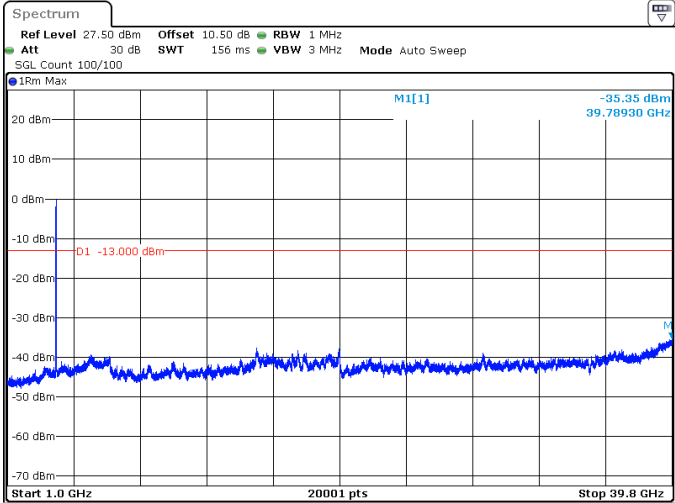


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 17:01:12

50MHz\_15kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.54 dBm

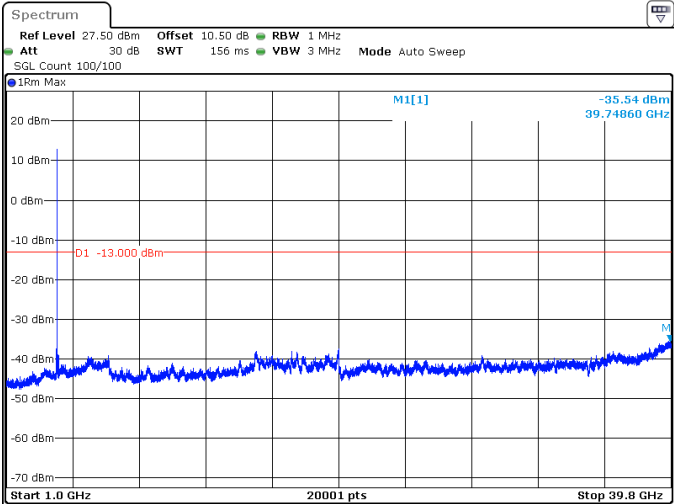


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 17:03:11

50MHz\_15kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB1@0 -47.05 dBm

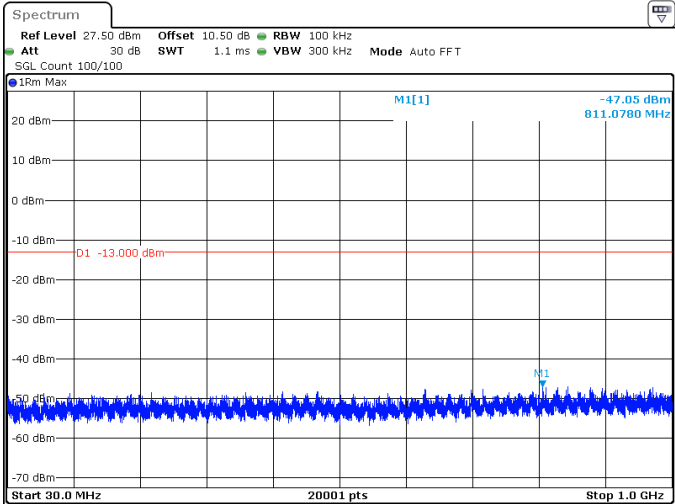


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 17:02:05

50MHz\_15kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB1@269 -34.65 dBm

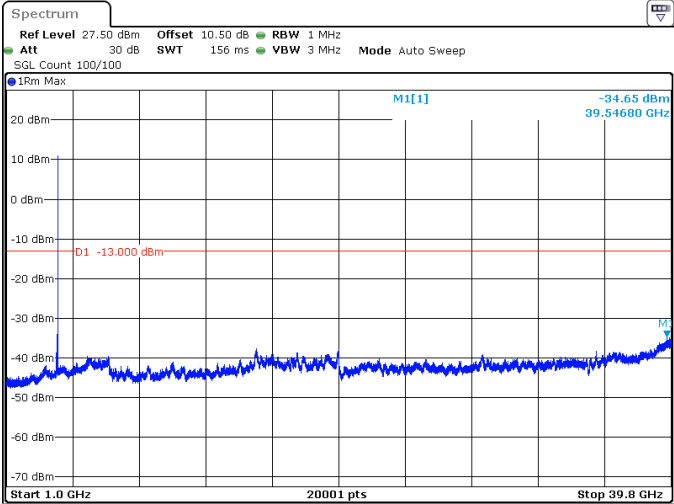


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 17:05:04

50MHz\_15kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB1@269 -46.35 dBm

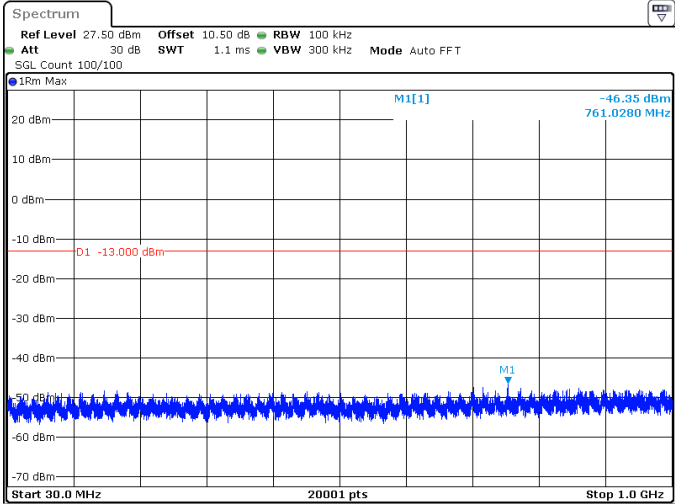


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 17:03:59

50MHz\_15kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB270@0 -46.52 dBm

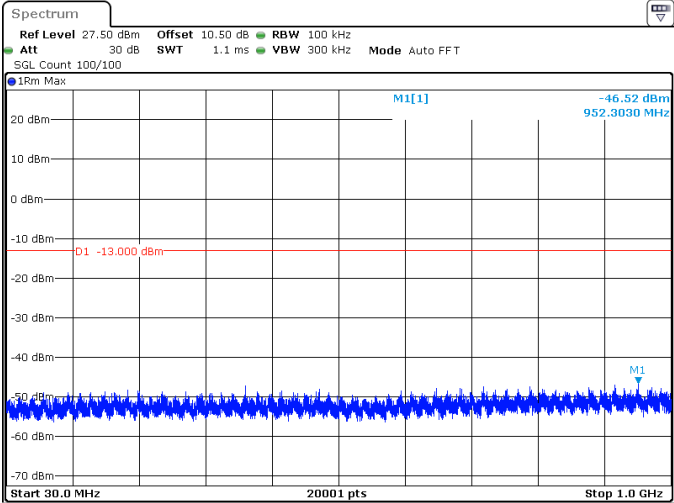


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 17:06:11

50MHz\_15kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB270@0 -34.98 dBm

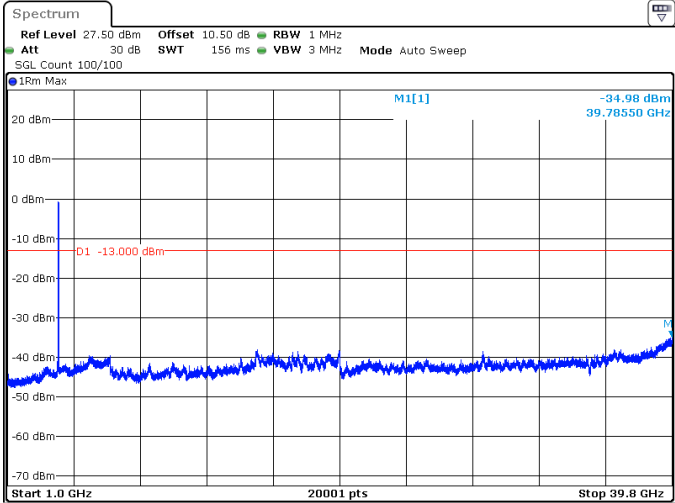


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 17:07:14

50MHz\_30kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.87 dBm

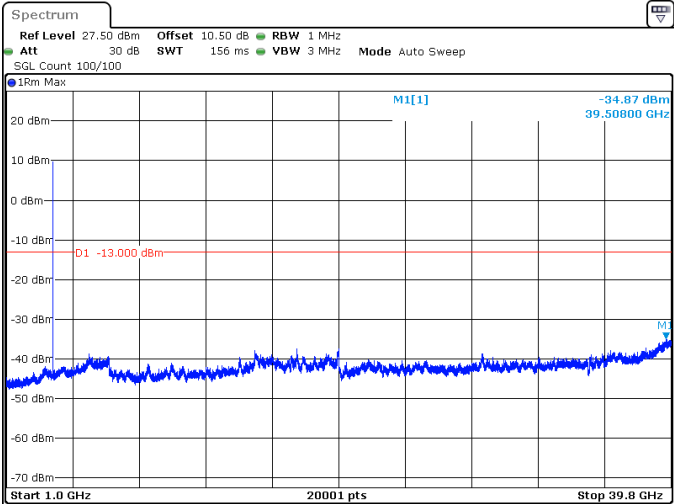


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:48:41

50MHz\_30kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.91 dBm

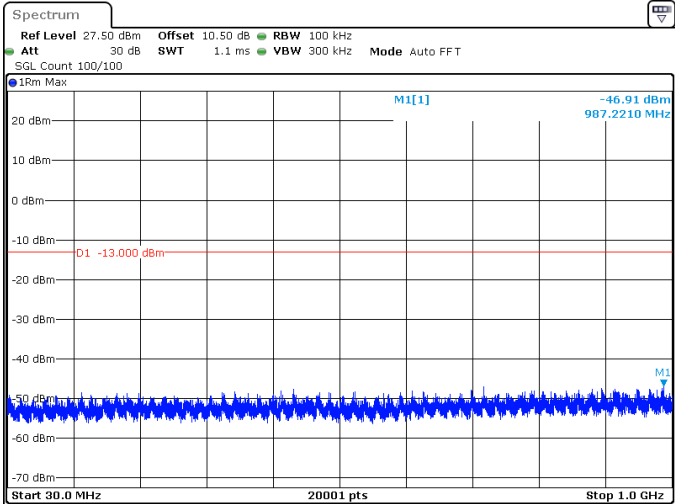


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:47:41

50MHz\_30kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB1@132 -35.21 dBm

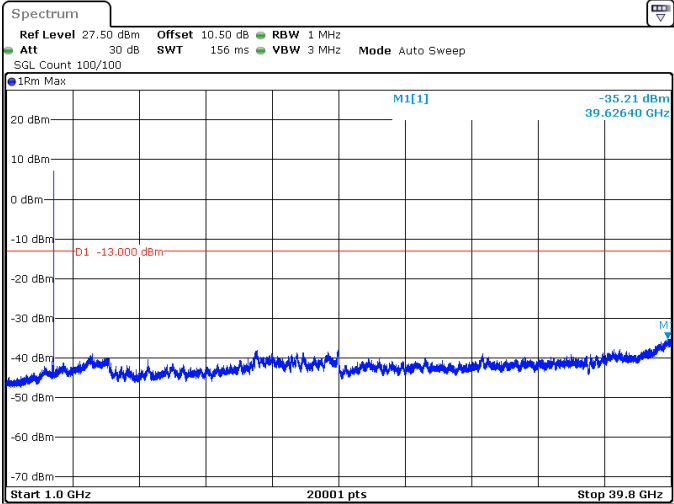


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:50:12

50MHz\_30kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB1@132 -46.47 dBm

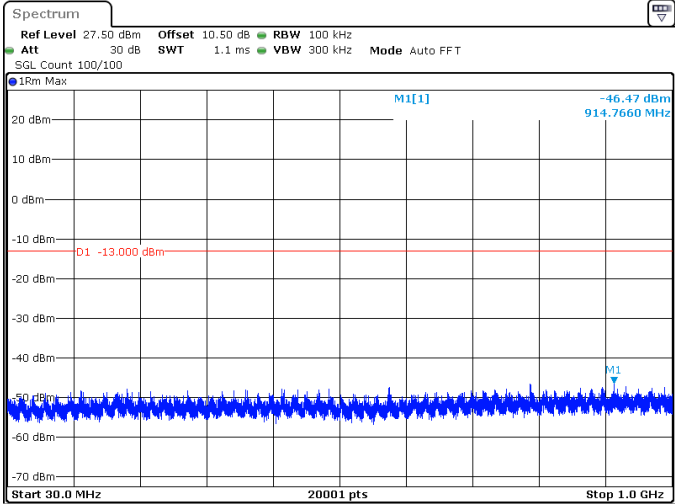


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:49:12

50MHz\_30kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB128@0 -47.09 dBm

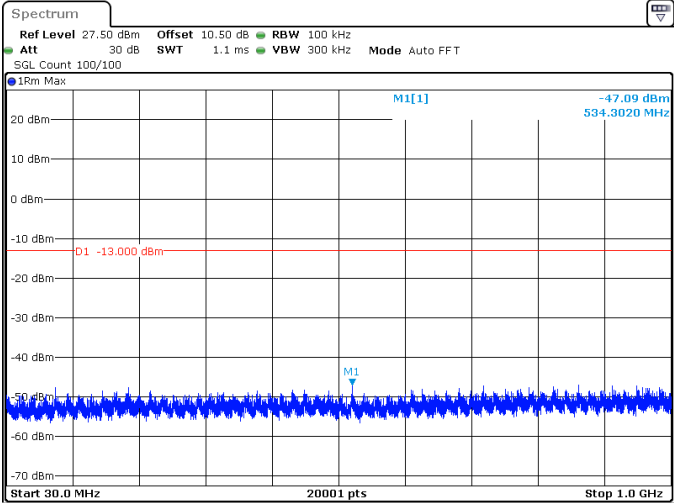


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:50:43

50MHz\_30kHz\_3725MHz\_DFT-s-OFDM QPSK\_RB128@0 -34.61 dBm

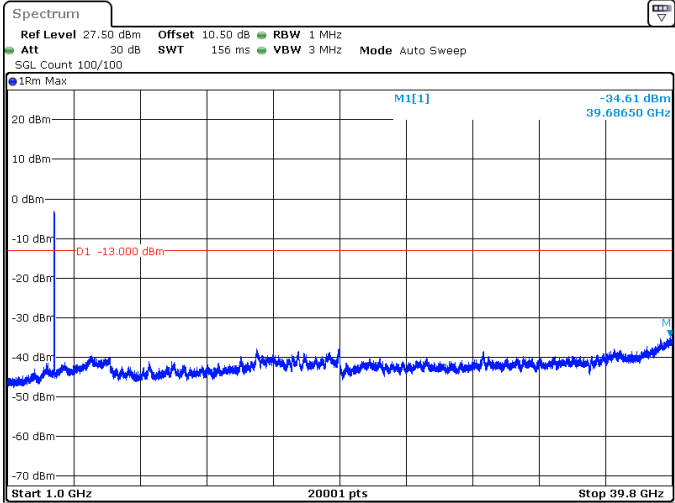


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:51:44

50MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.46 dBm

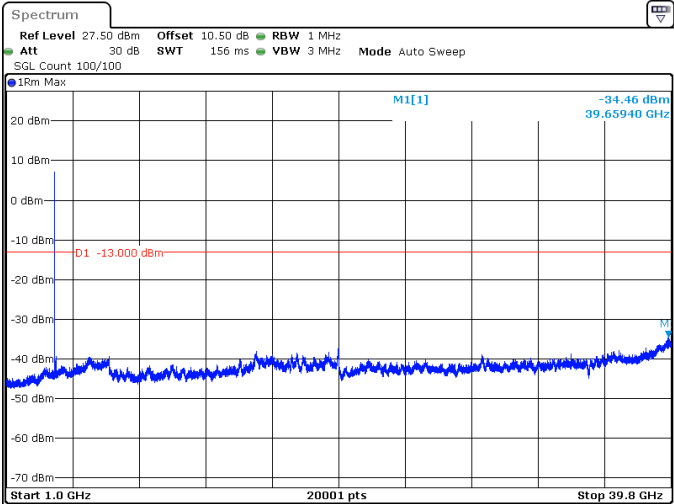


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:53:20

50MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.97 dBm

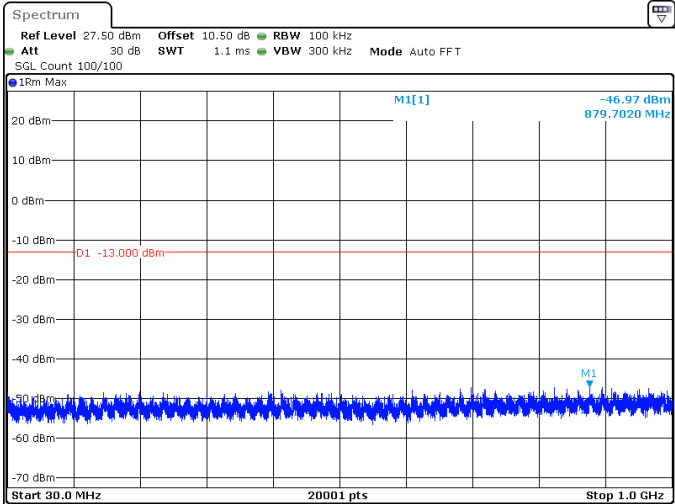


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:52:20

50MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@132 -35.14 dBm

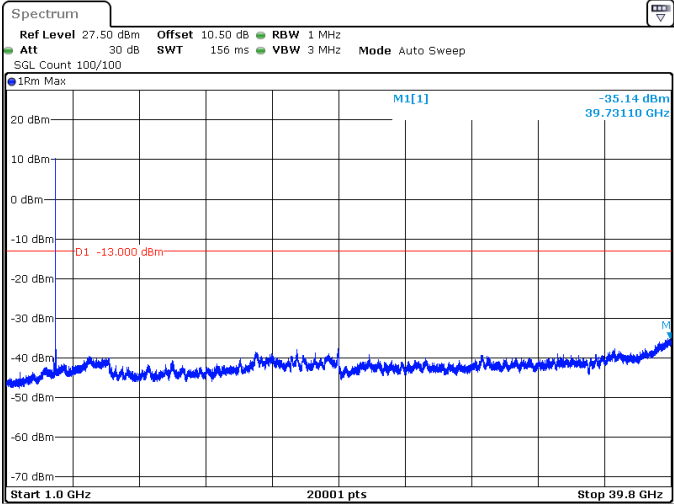


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:54:53

50MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@132 -46.11 dBm

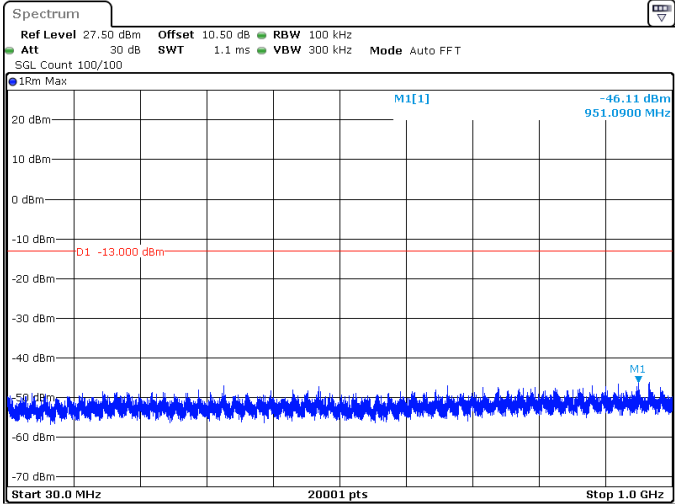


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:53:52

50MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB128@0 -47.14 dBm

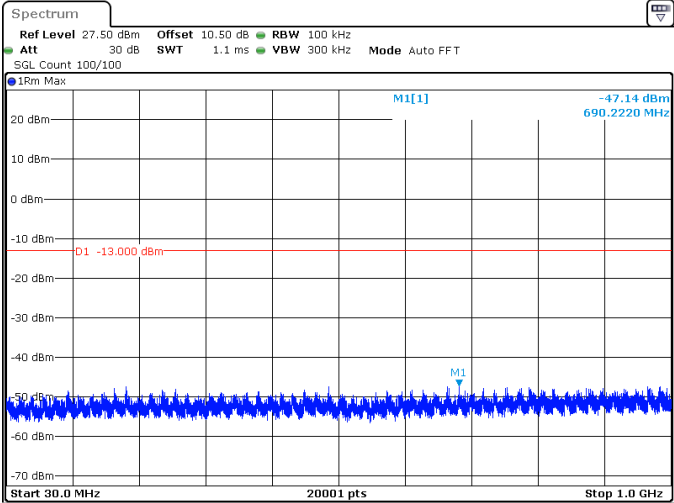


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:55:25

50MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB128@0 -35.29 dBm

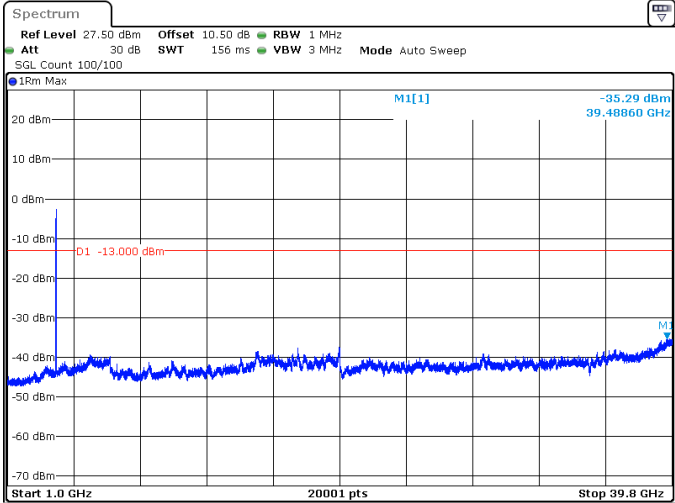


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:56:26

50MHz\_30kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.26 dBm

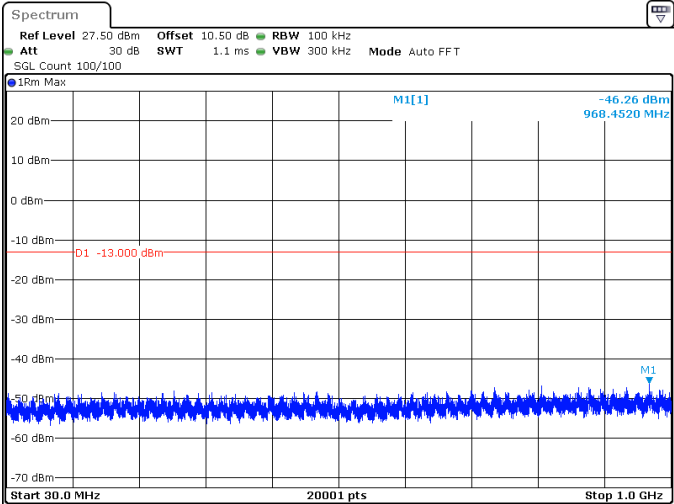


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:57:01

50MHz\_30kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.78 dBm

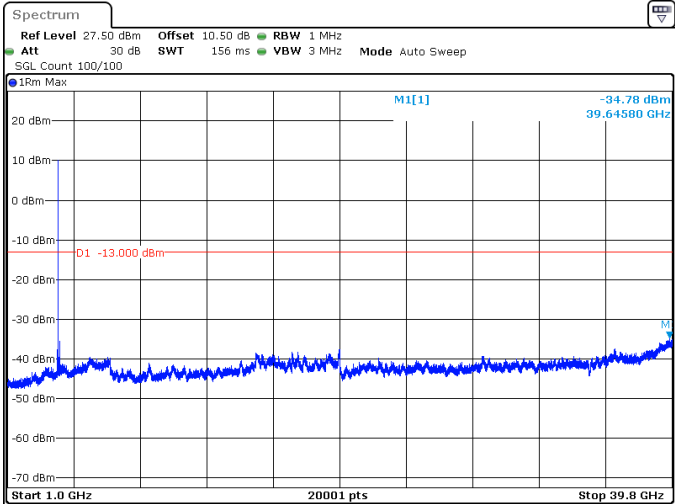


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:58:01

50MHz\_30kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB1@132 -35.24 dBm

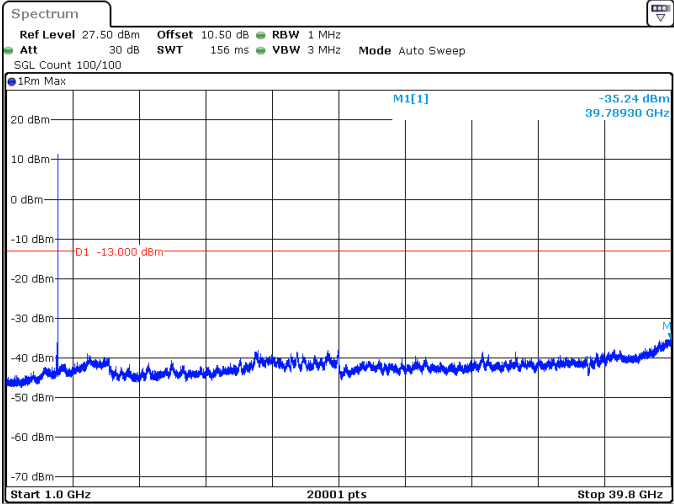


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:59:33

50MHz\_30kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB1@132 -46.22 dBm

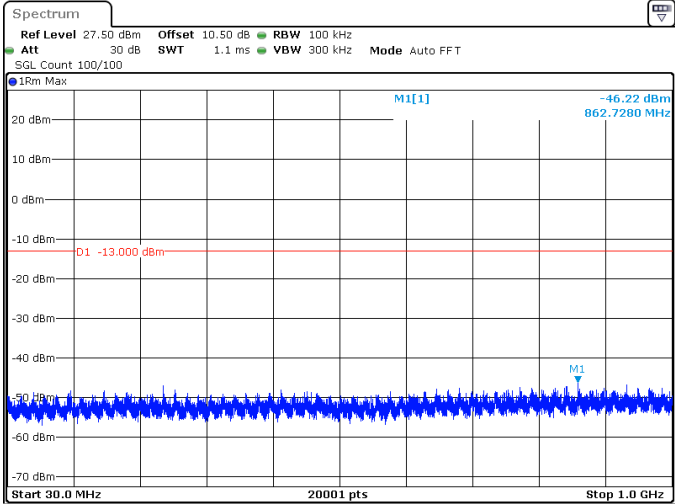


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 11:58:33

50MHz\_30kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB128@0 -34.95 dBm

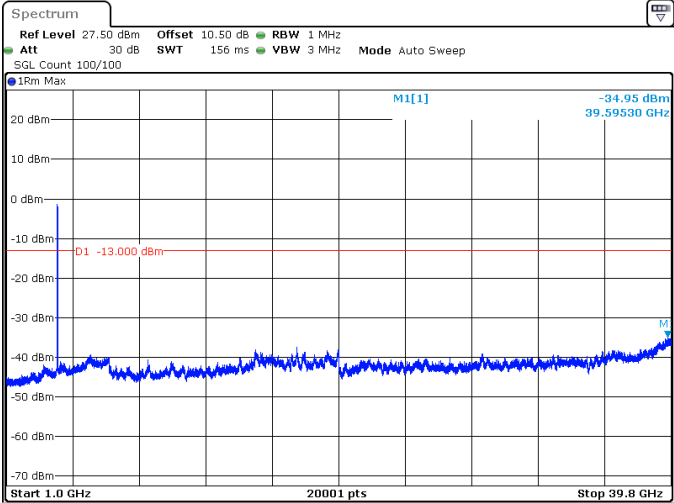


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:01:06

50MHz\_30kHz\_3955MHz\_DFT-s-OFDM QPSK\_RB128@0 -46.69 dBm

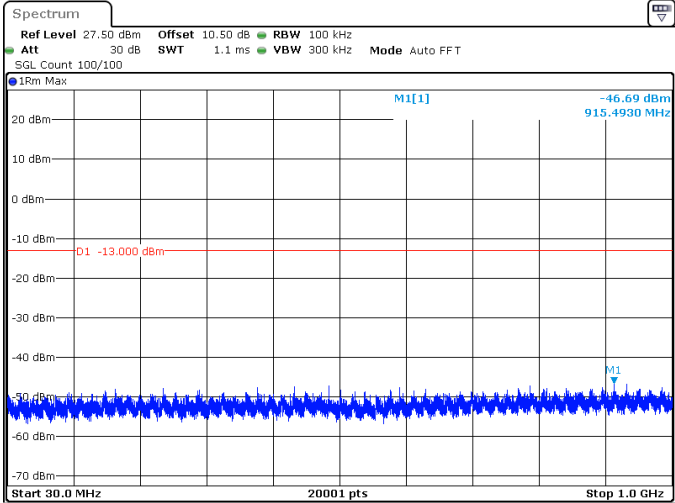


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:00:05

60MHz\_30kHz\_3730MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.40 dBm

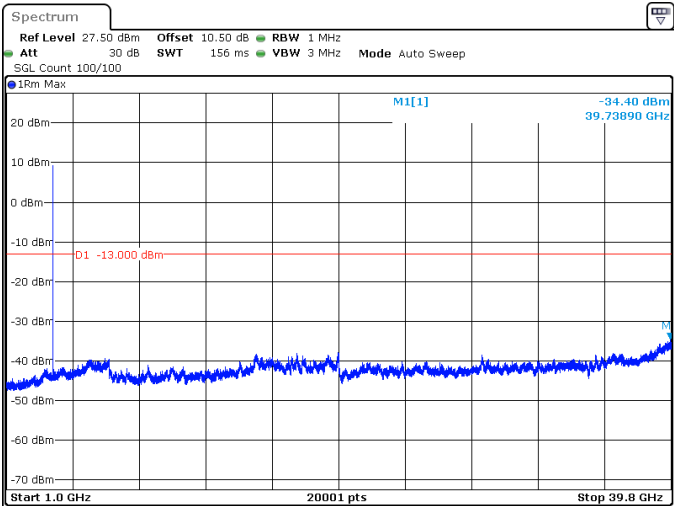


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:02:46

60MHz\_30kHz\_3730MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.73 dBm

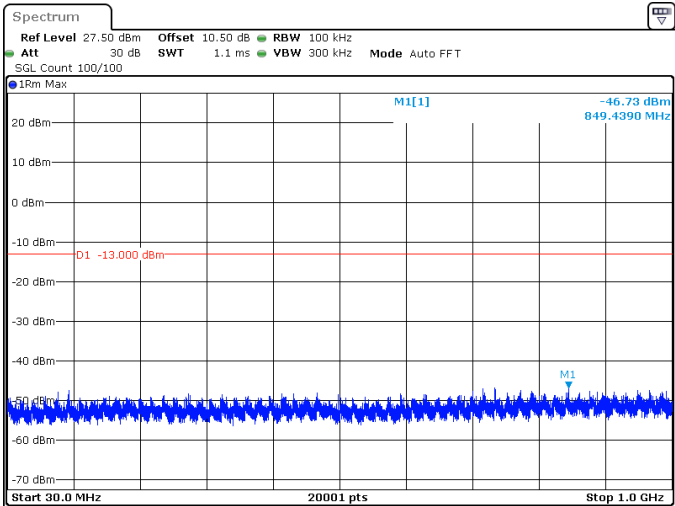


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:01:45

60MHz\_30kHz\_3730MHz\_DFT-s-OFDM QPSK\_RB1@161 -46.48 dBm

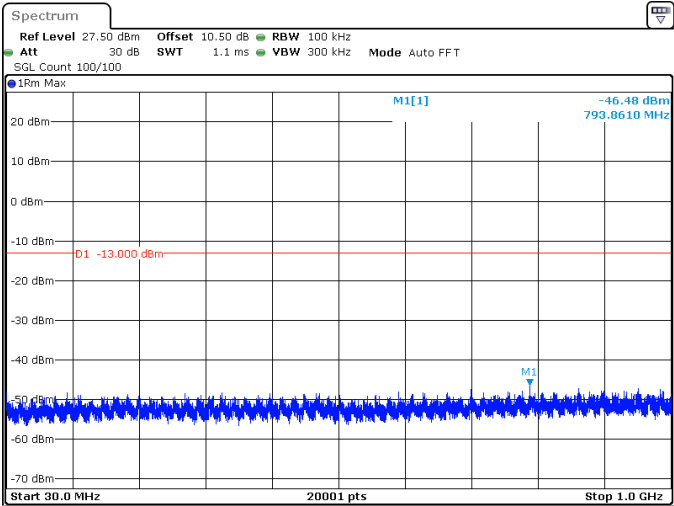


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:03:17

60MHz\_30kHz\_3730MHz\_DFT-s-OFDM QPSK\_RB1@161 -34.73 dBm

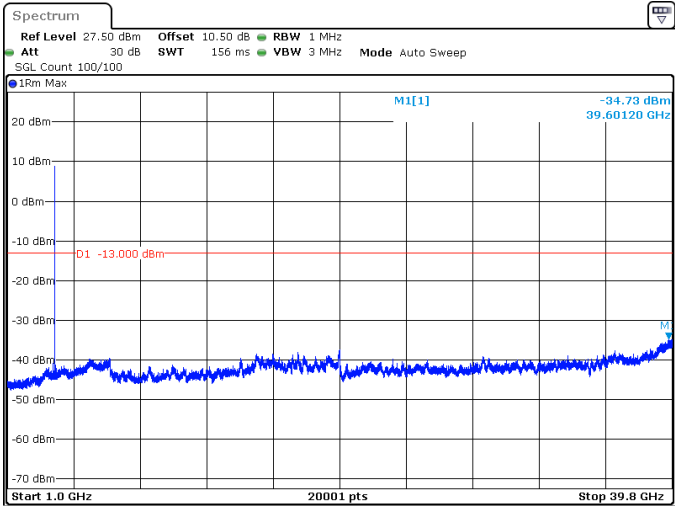


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:04:19

60MHz\_30kHz\_3730MHz\_DFT-s-OFDM QPSK\_RB162@0 -35.24 dBm

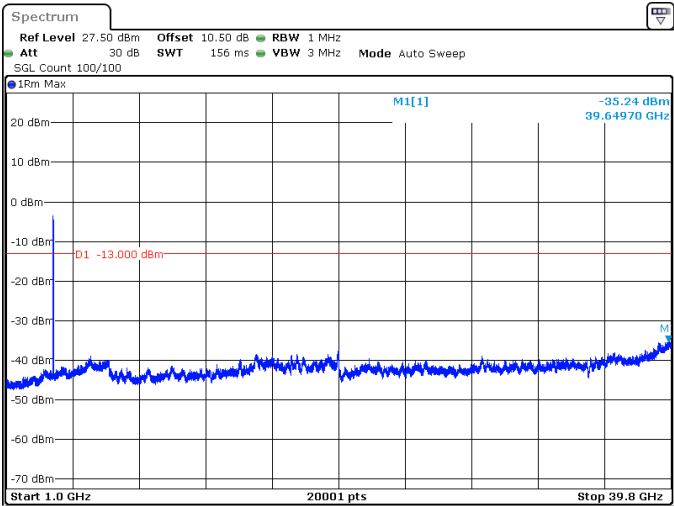


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:06:11

60MHz\_30kHz\_3730MHz\_DFT-s-OFDM QPSK\_RB162@0 -46.92 dBm

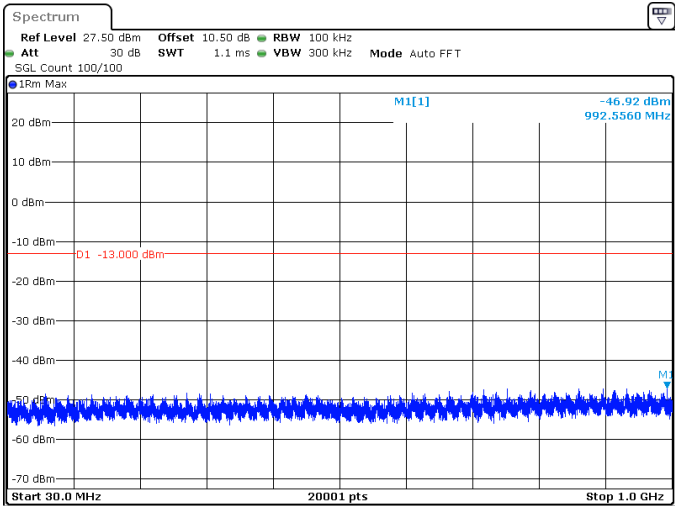


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:05:09

60MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.02 dBm

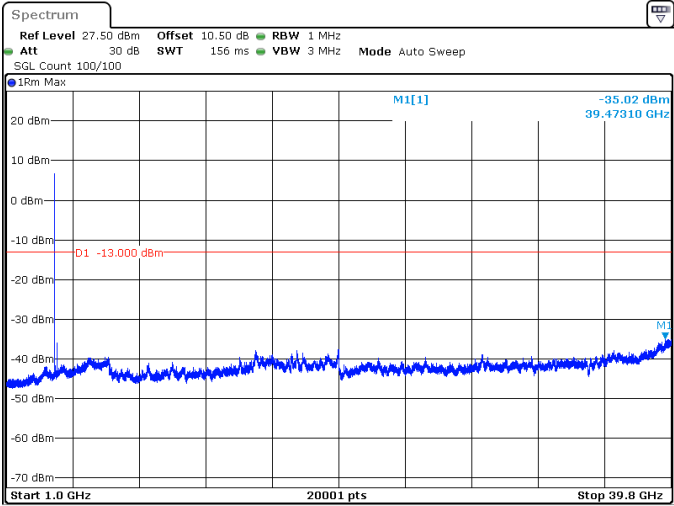


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:31:10

60MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.32 dBm

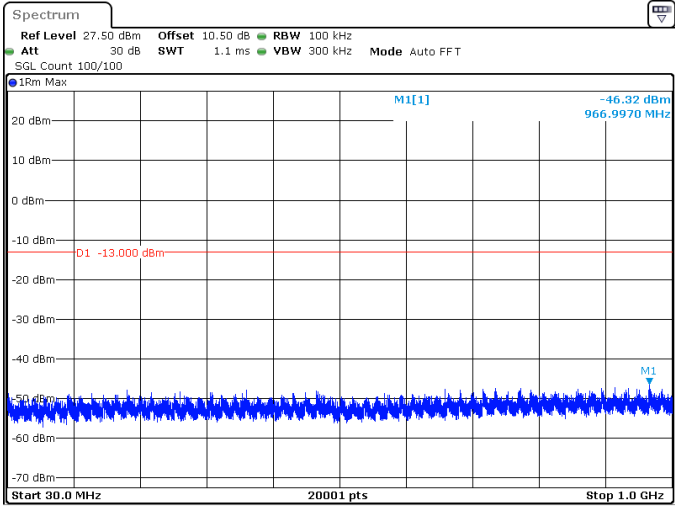


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:30:09

60MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@161 -35.12 dBm

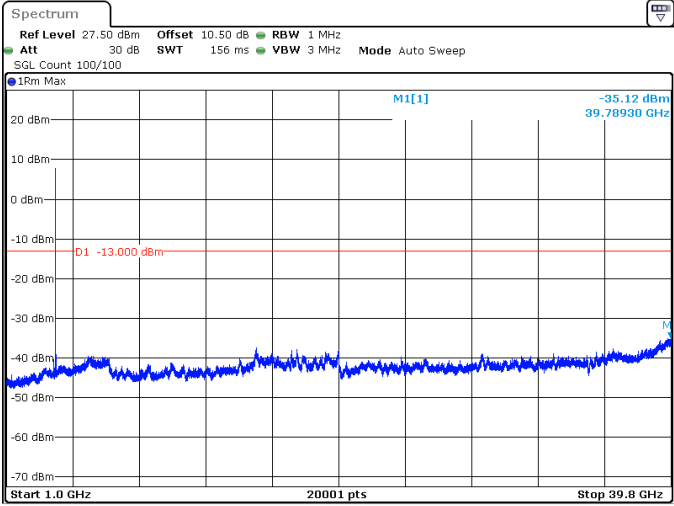


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:32:44

60MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@161 -47.32 dBm

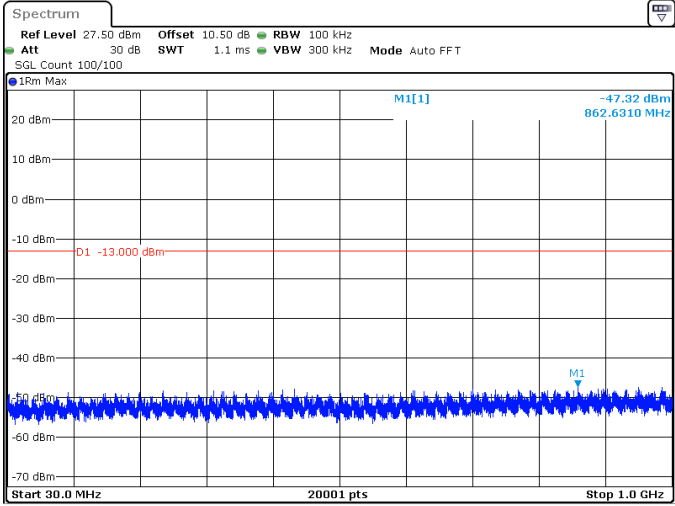


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:31:43

60MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB162@0 -34.99 dBm

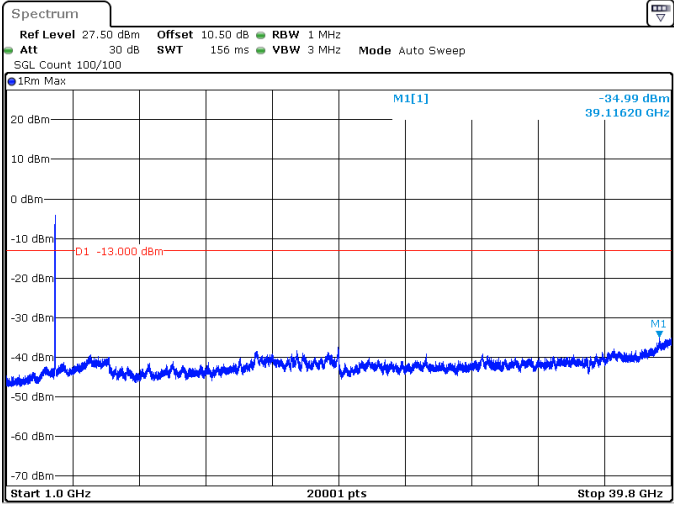


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:34:18

60MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB162@0 -46.46 dBm

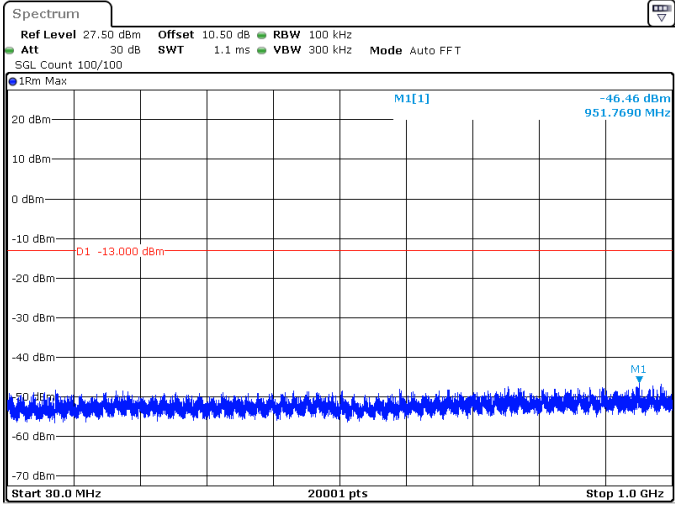


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:33:17

60MHz\_30kHz\_3950MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.09 dBm

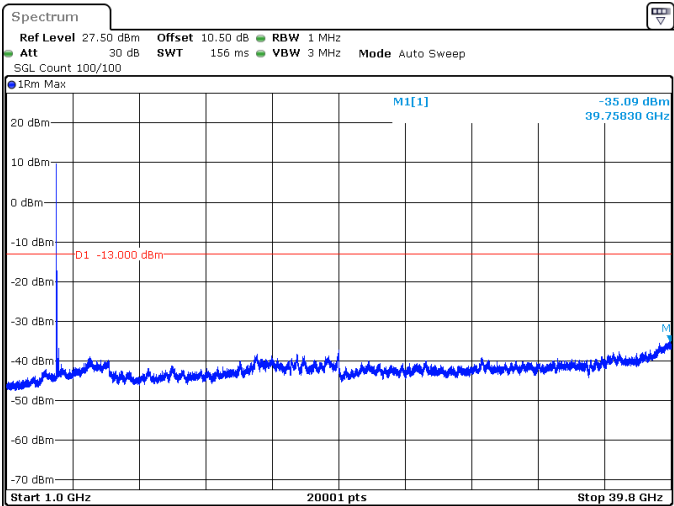


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:39:59

60MHz\_30kHz\_3950MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.47 dBm

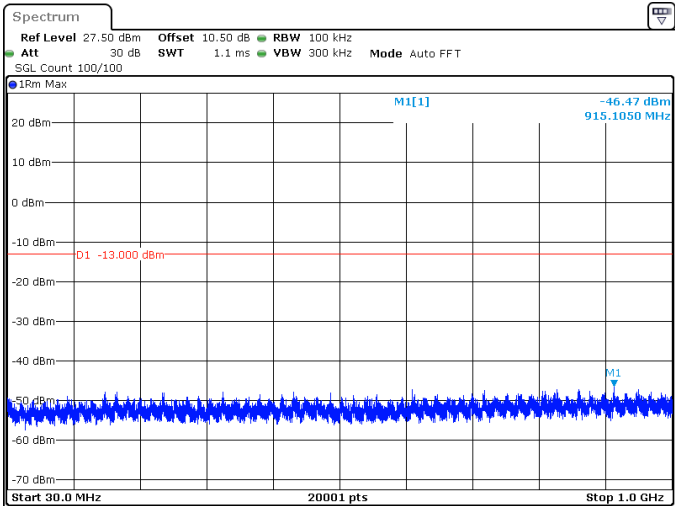


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:38:58

60MHz\_30kHz\_3950MHz\_DFT-s-OFDM QPSK\_RB1@161 -46.45 dBm

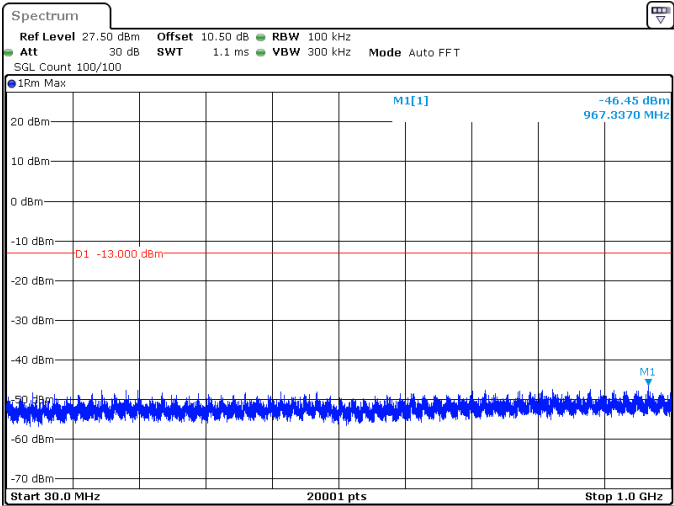


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:40:32

60MHz\_30kHz\_3950MHz\_DFT-s-OFDM QPSK\_RB1@161 -35.03 dBm

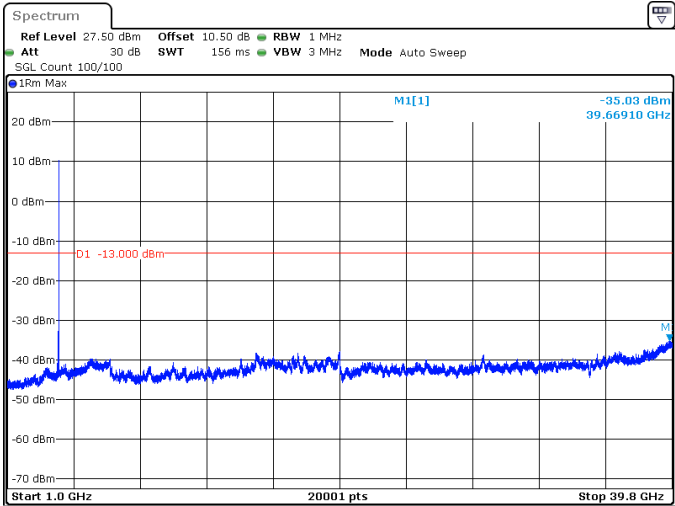


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:41:34

60MHz\_30kHz\_3950MHz\_DFT-s-OFDM QPSK\_RB162@0 -35.14 dBm

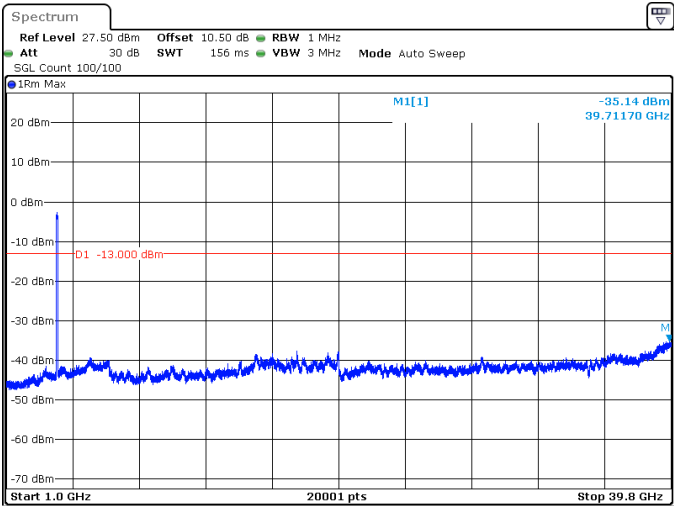


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:43:10

60MHz\_30kHz\_3950MHz\_DFT-s-OFDM QPSK\_RB162@0 -46.72 dBm

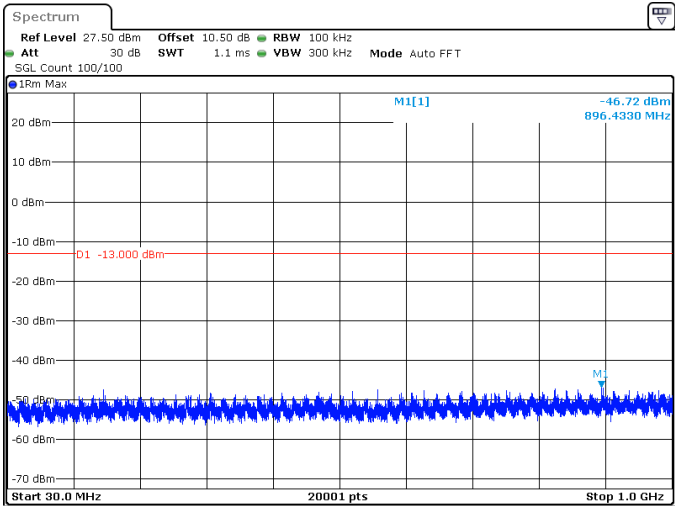


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:42:08

70MHz\_30kHz\_3735MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.84 dBm

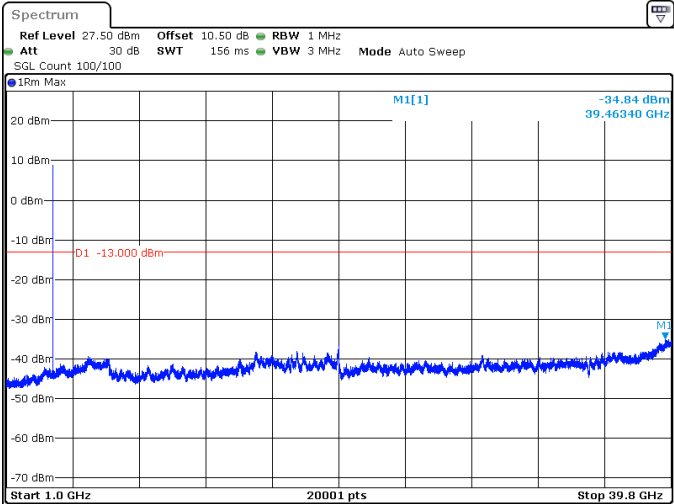


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:44:53

70MHz\_30kHz\_3735MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.14 dBm

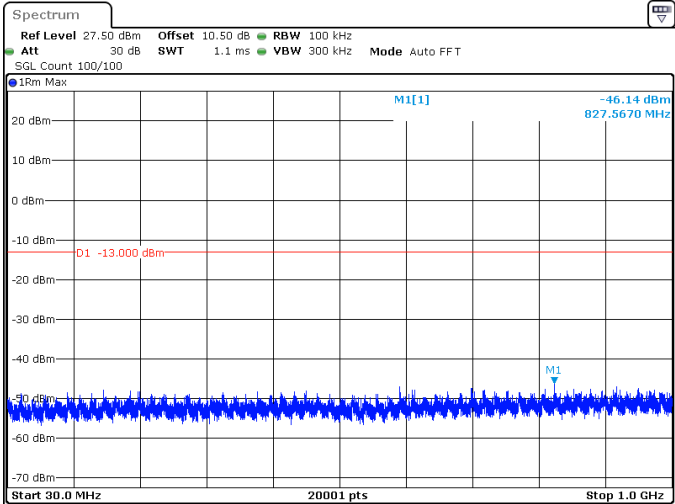


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:43:52

70MHz\_30kHz\_3735MHz\_DFT-s-OFDM QPSK\_RB1@188 -46.29 dBm

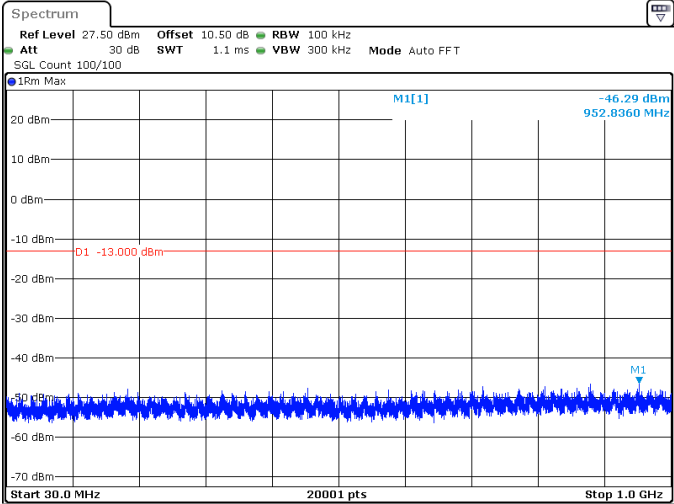


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:45:27

70MHz\_30kHz\_3735MHz\_DFT-s-OFDM QPSK\_RB1@188 -34.89 dBm

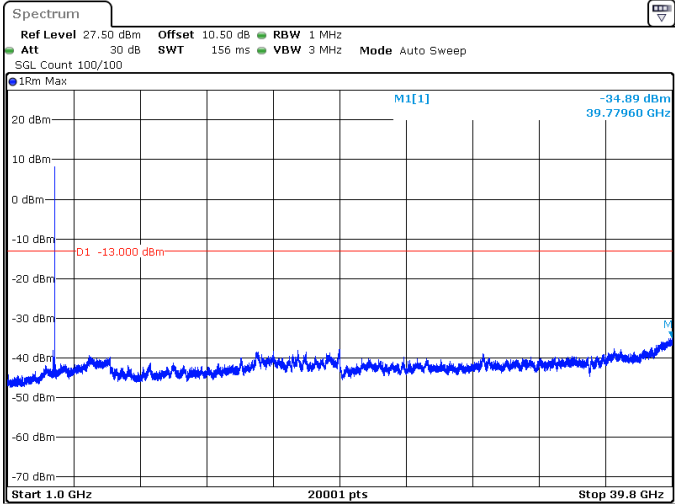


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:46:28

70MHz\_30kHz\_3735MHz\_DFT-s-OFDM QPSK\_RB180@0 -46.86 dBm

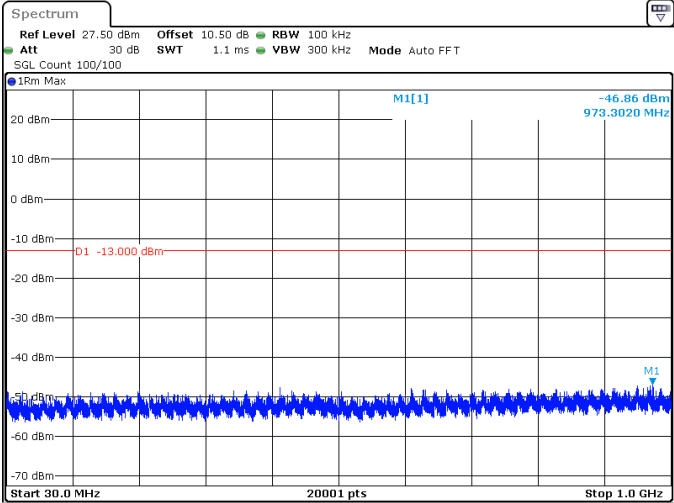


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:47:04

70MHz\_30kHz\_3735MHz\_DFT-s-OFDM QPSK\_RB180@0 -34.44 dBm

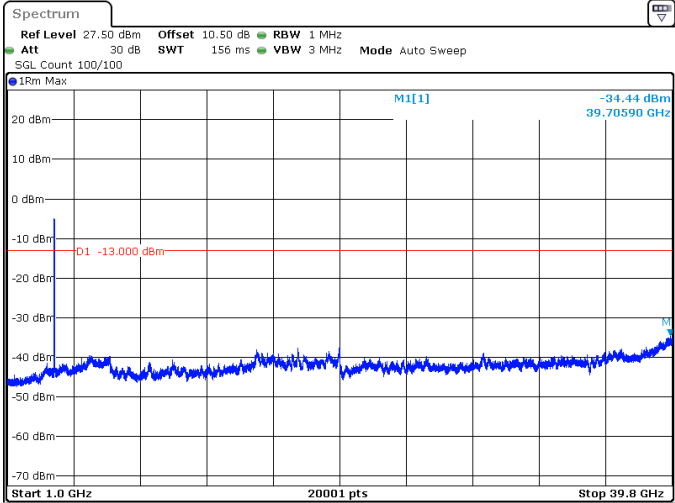


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:48:05

70MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.67 dBm

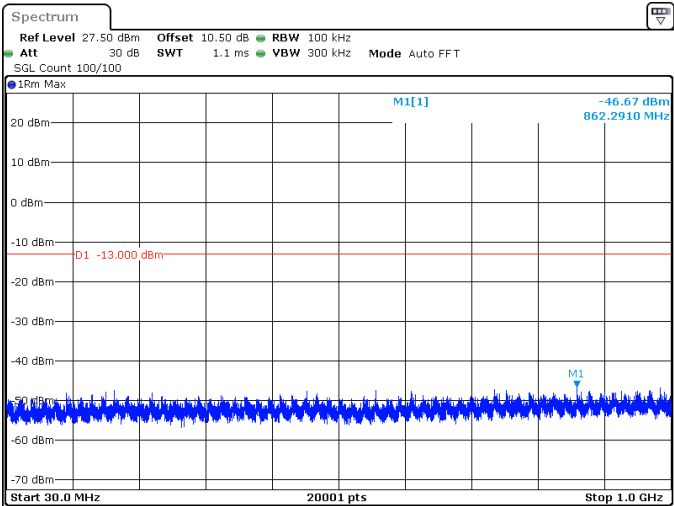


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:48:44

70MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.11 dBm

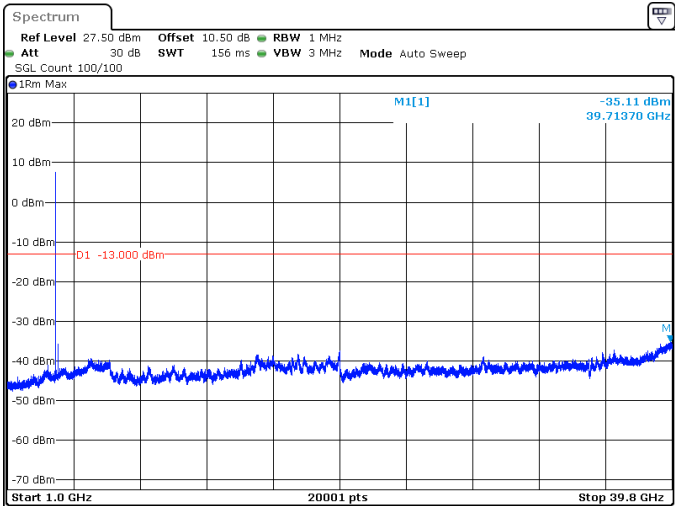


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:49:46

70MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@188 -47.23 dBm

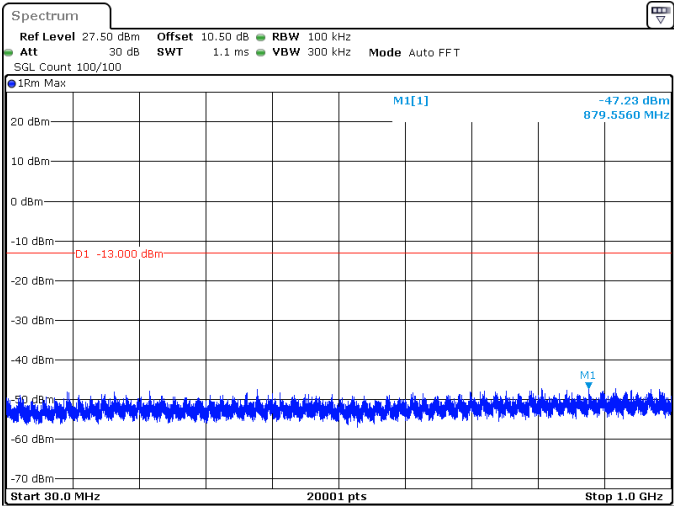


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:50:19

70MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@188 -34.93 dBm

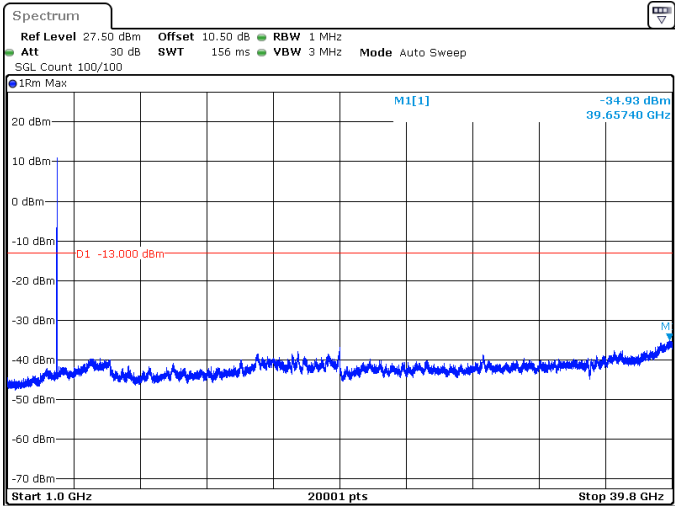


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:51:21

70MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB180@0 -34.79 dBm

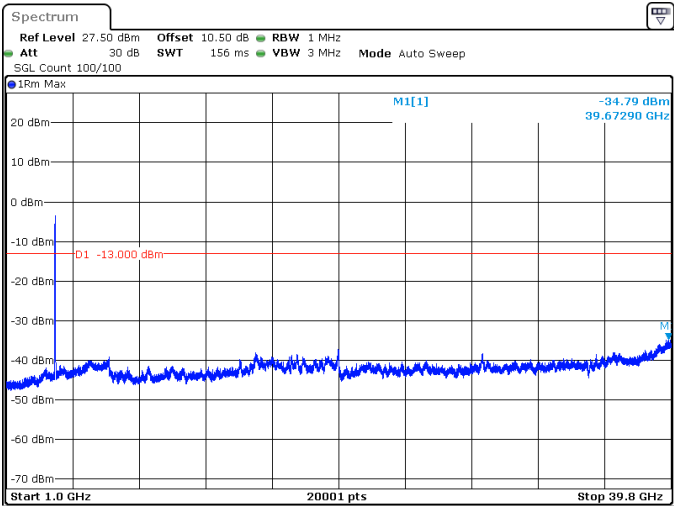


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:52:57

70MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB180@0 -46.64 dBm

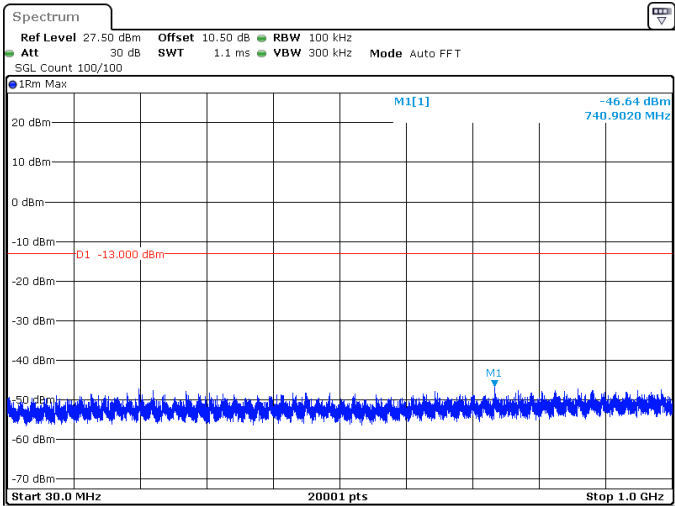


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:51:56

70MHz\_30kHz\_3945MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.70 dBm

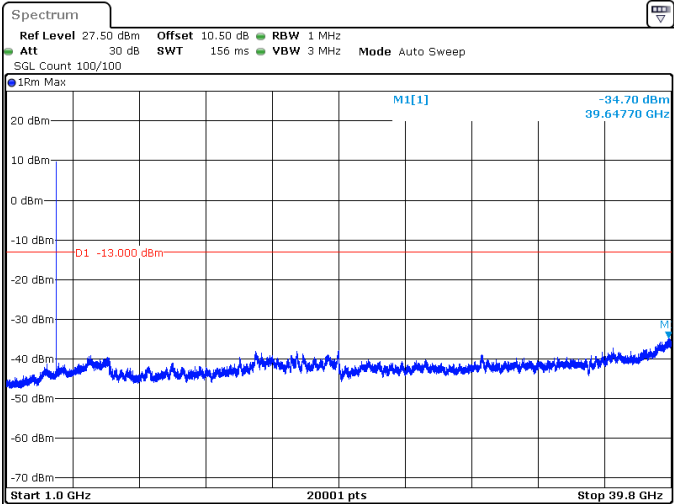


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:54:39

70MHz\_30kHz\_3945MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.79 dBm

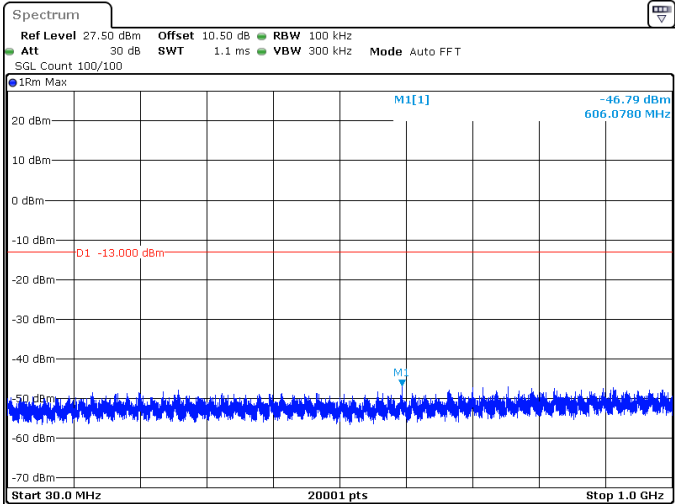


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:53:37

70MHz\_30kHz\_3945MHz\_DFT-s-OFDM QPSK\_RB1@188 -34.92 dBm

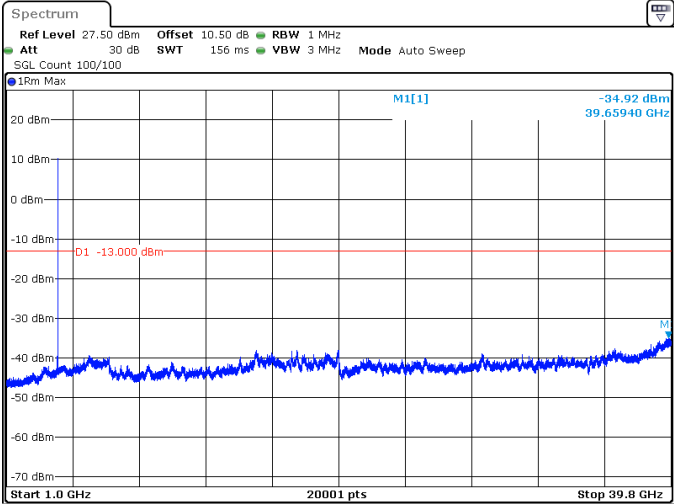


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:56:17

70MHz\_30kHz\_3945MHz\_DFT-s-OFDM QPSK\_RB1@188 -47.13 dBm

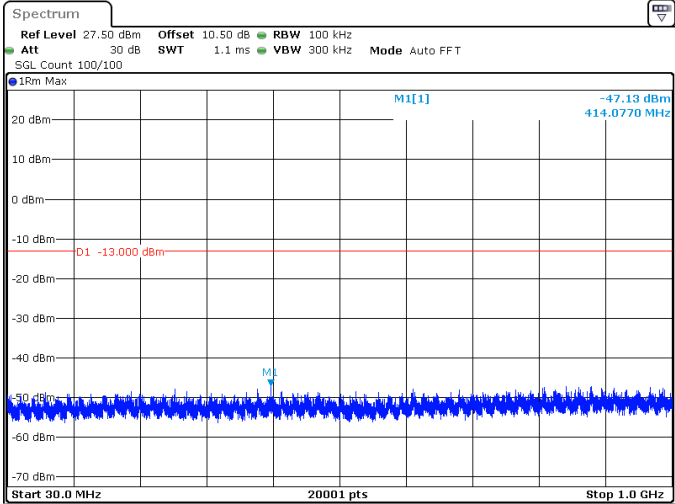


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:55:16

70MHz\_30kHz\_3945MHz\_DFT-s-OFDM QPSK\_RB180@0 -47.07 dBm

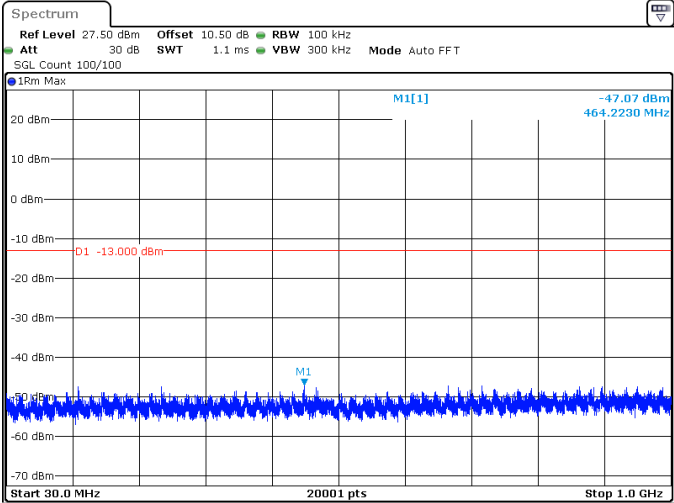


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:56:51

70MHz\_30kHz\_3945MHz\_DFT-s-OFDM QPSK\_RB180@0 -34.90 dBm

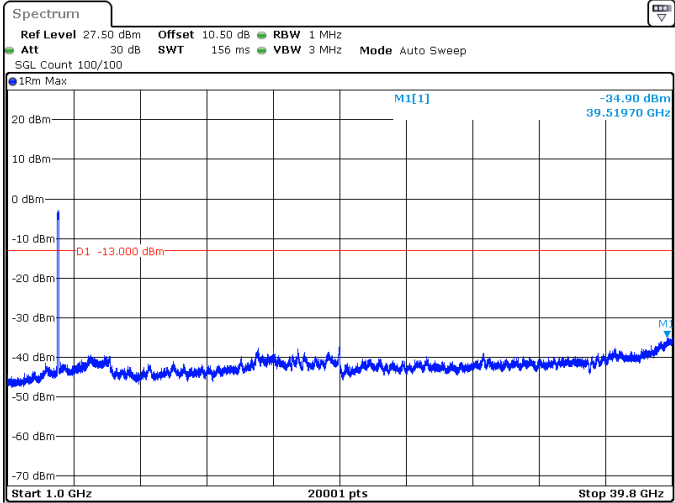


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:57:52

80MHz\_30kHz\_3740MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.33 dBm

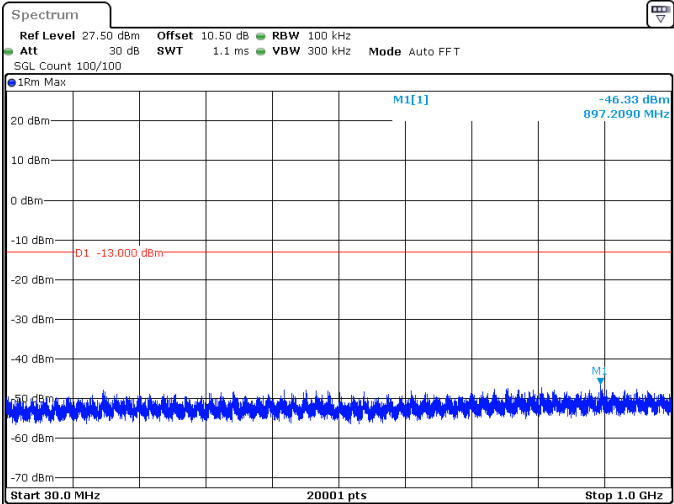


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:58:36

80MHz\_30kHz\_3740MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.68 dBm

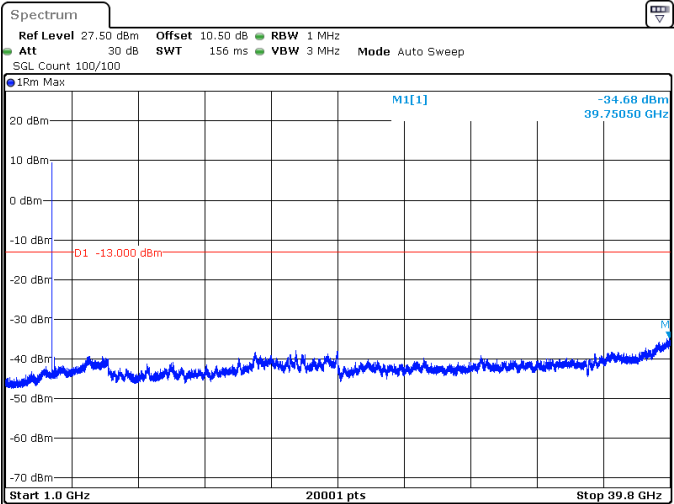


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 12:59:38

80MHz\_30kHz\_3740MHz\_DFT-s-OFDM QPSK\_RB1@216 -47.25 dBm

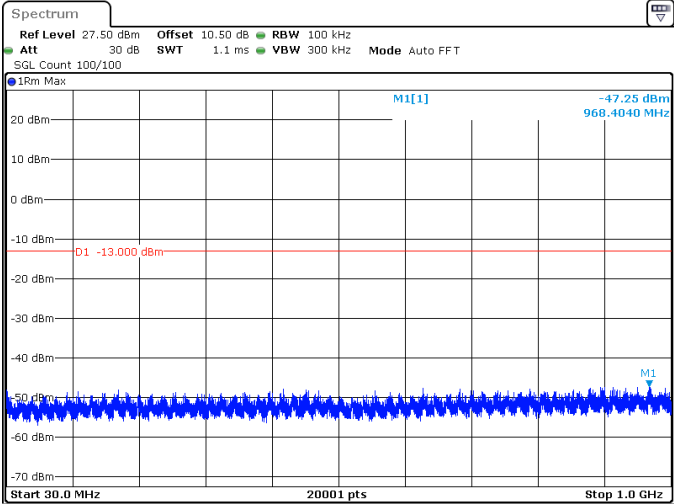


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:00:13

80MHz\_30kHz\_3740MHz\_DFT-s-OFDM QPSK\_RB1@216 -35.30 dBm

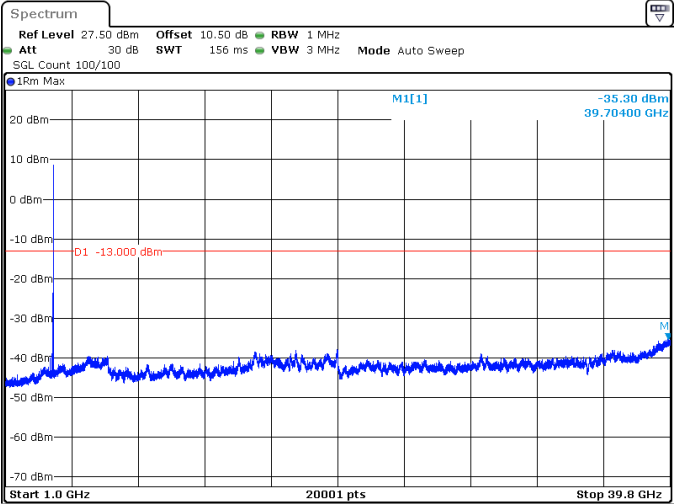


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:01:15

80MHz\_30kHz\_3740MHz\_DFT-s-OFDM QPSK\_RB216@0 -34.61 dBm

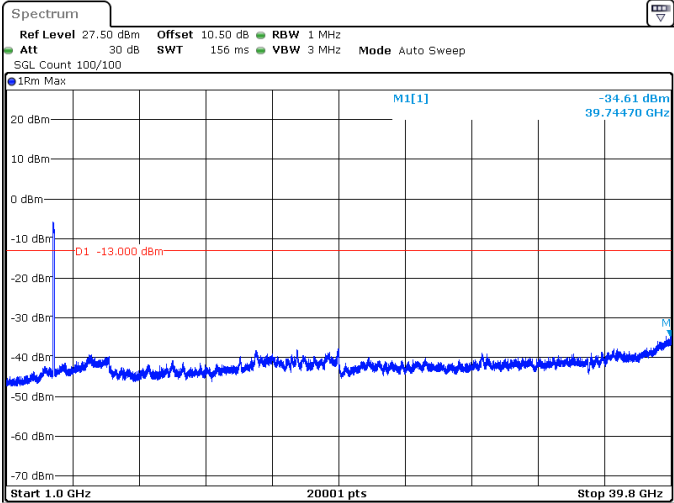


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:02:50

80MHz\_30kHz\_3740MHz\_DFT-s-OFDM QPSK\_RB216@0 -46.43 dBm

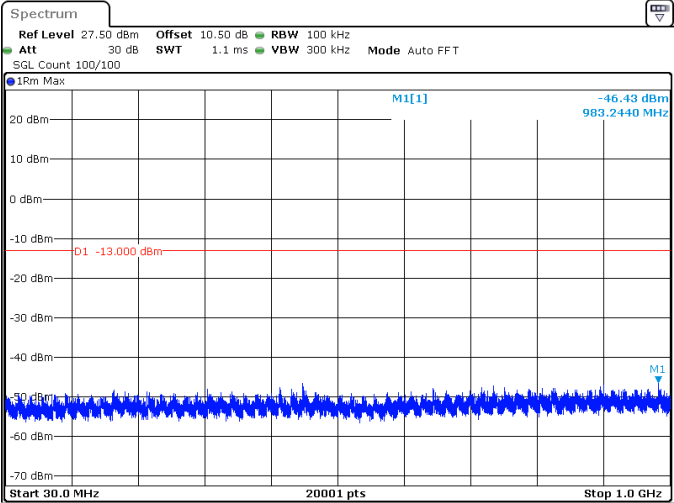


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:01:49

80MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.35 dBm

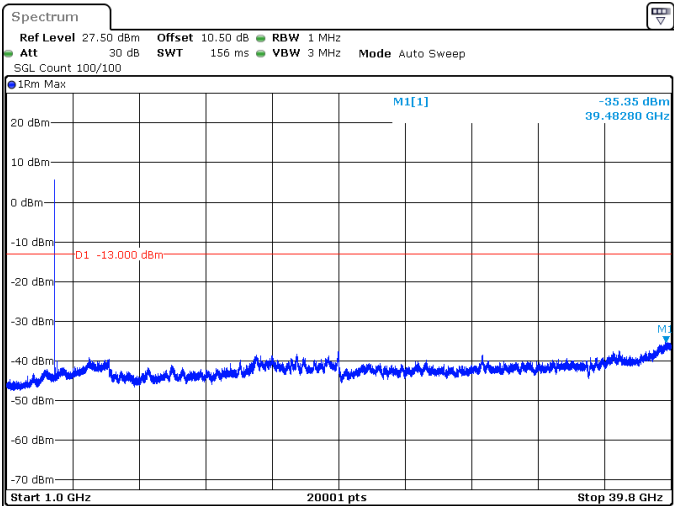


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:04:31

80MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -47.34 dBm

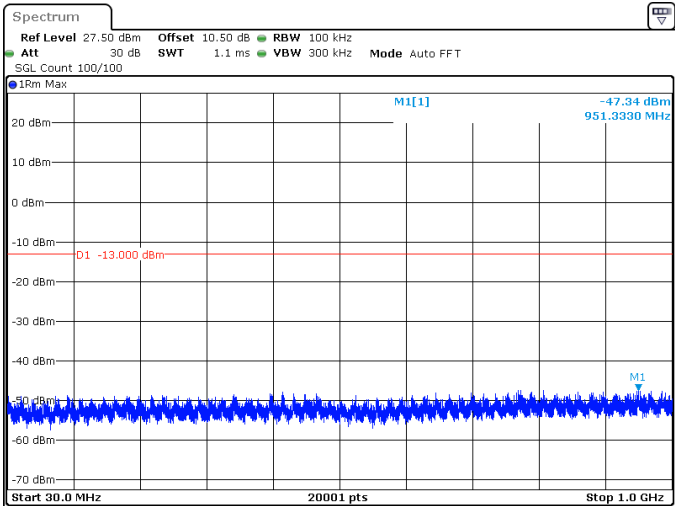


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:03:29

80MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@216 -46.92 dBm

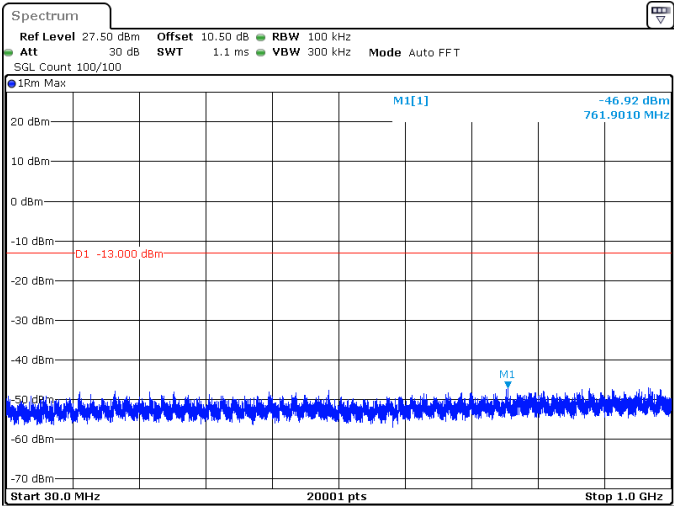


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:05:05

80MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@216 -35.04 dBm

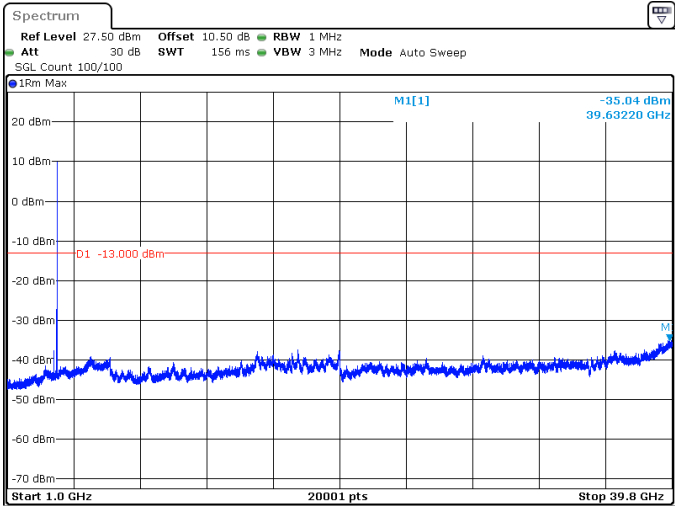


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:06:06

80MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB216@0 -46.27 dBm

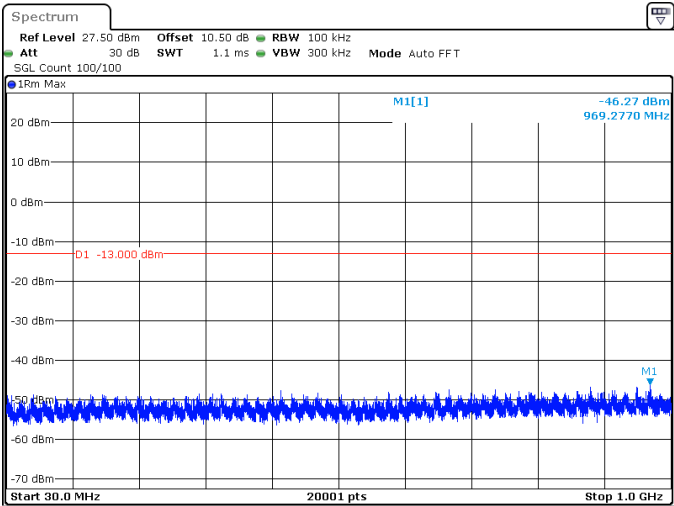


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:06:41

80MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB216@0 -34.82 dBm

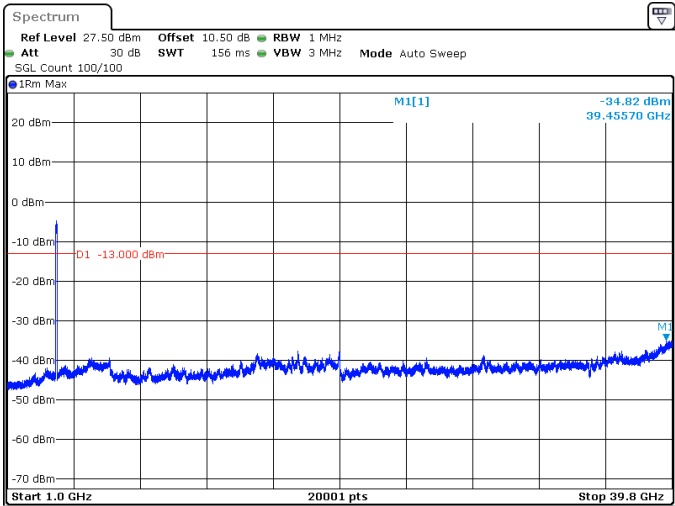


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:07:42

80MHz\_30kHz\_3940MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.31 dBm

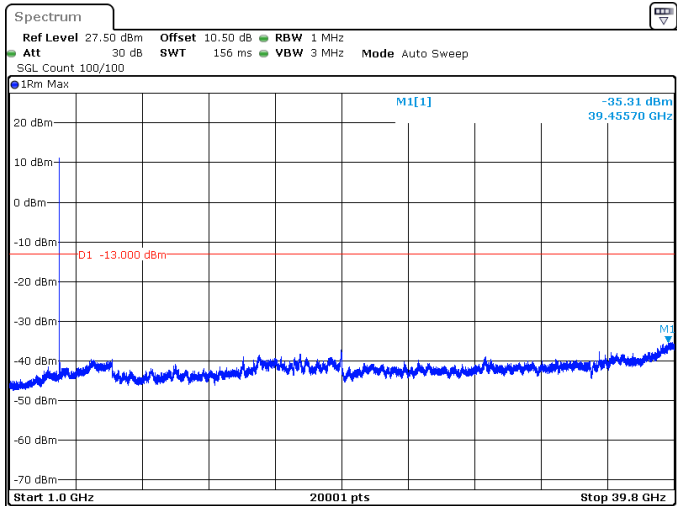


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:09:23

80MHz\_30kHz\_3940MHz\_DFT-s-OFDM QPSK\_RB1@0 -47.25 dBm

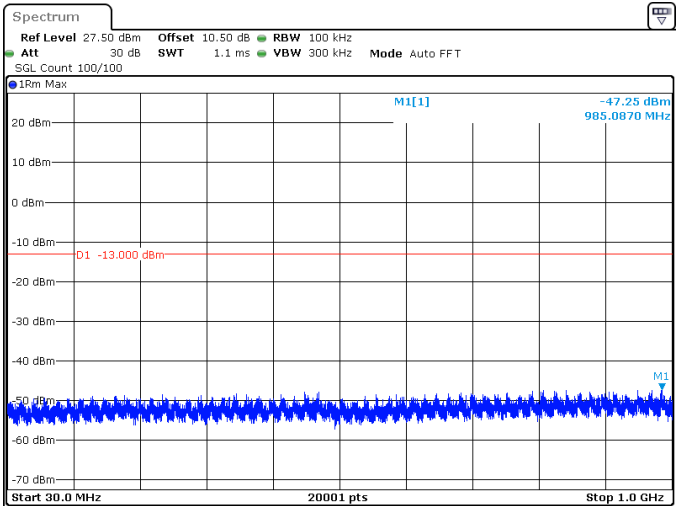


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:08:22

80MHz\_30kHz\_3940MHz\_DFT-s-OFDM QPSK\_RB1@216 -46.16 dBm

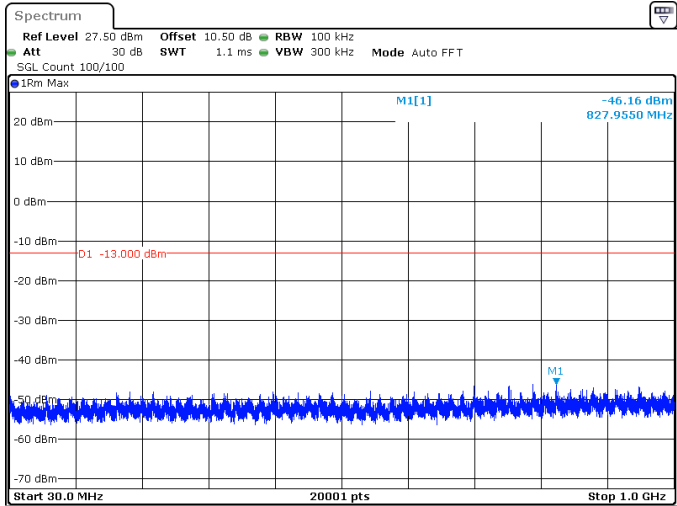


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:09:59

80MHz\_30kHz\_3940MHz\_DFT-s-OFDM QPSK\_RB1@216 -34.61 dBm

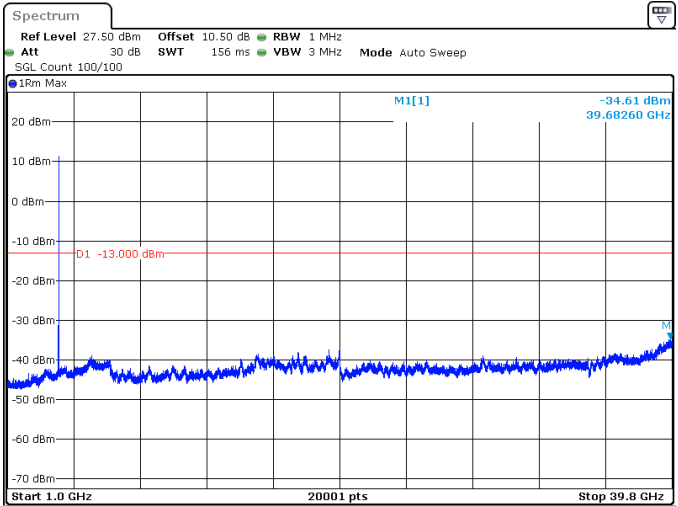


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:11:02

80MHz\_30kHz\_3940MHz\_DFT-s-OFDM QPSK\_RB216@0 -35.05 dBm

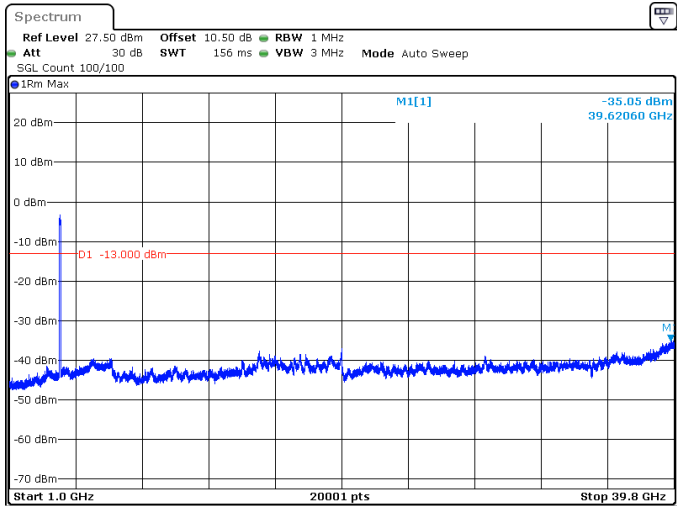


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:12:41

80MHz\_30kHz\_3940MHz\_DFT-s-OFDM QPSK\_RB216@0 -46.87 dBm

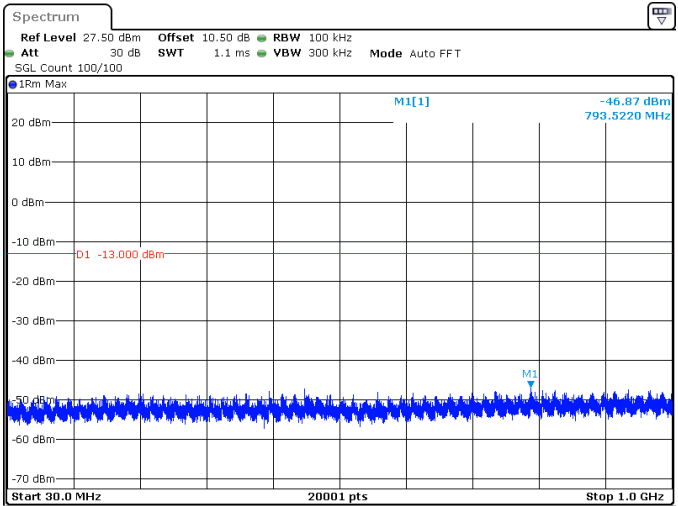


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:11:40

90MHz\_30kHz\_3745MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.25 dBm

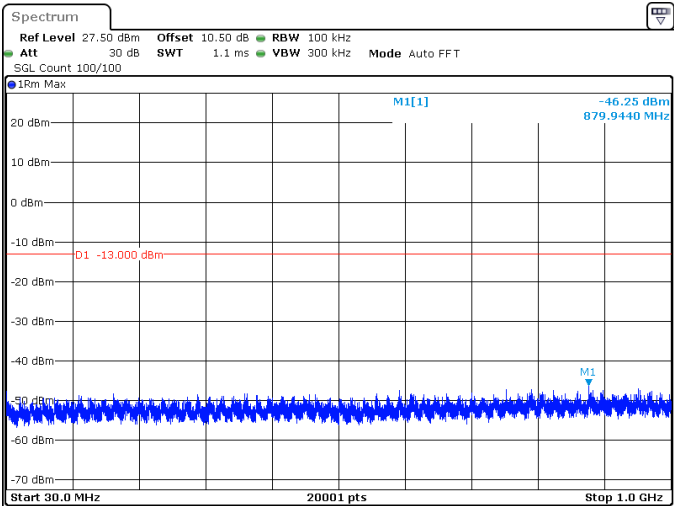


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:13:26

90MHz\_30kHz\_3745MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.29 dBm

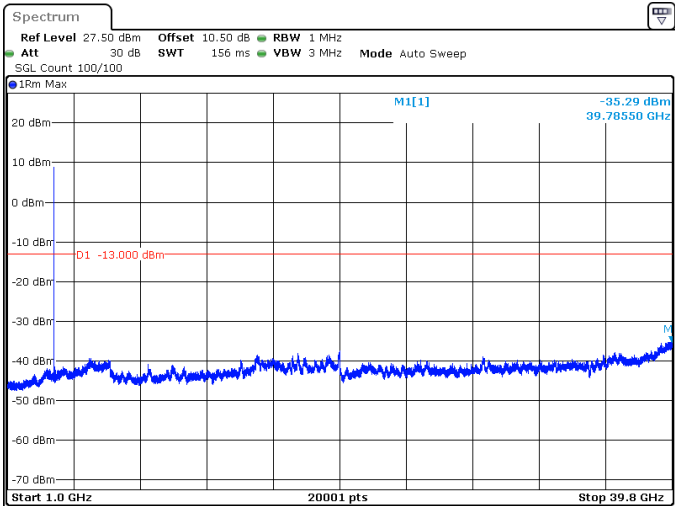


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:14:28

90MHz\_30kHz\_3745MHz\_DFT-s-OFDM QPSK\_RB1@244 -46.28 dBm

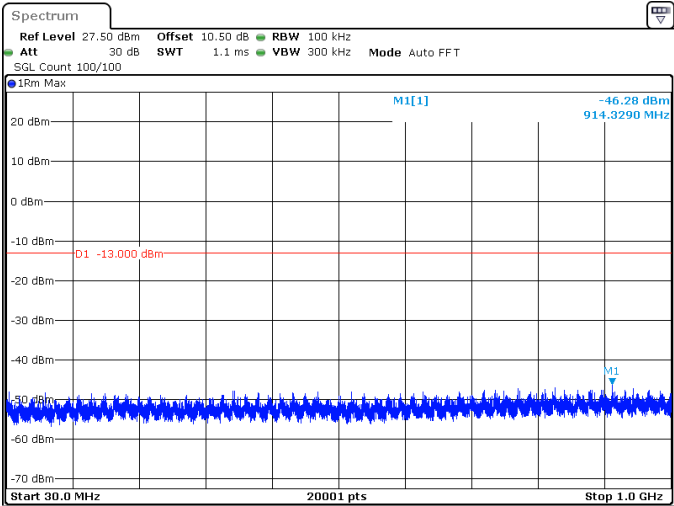


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:15:04

90MHz\_30kHz\_3745MHz\_DFT-s-OFDM QPSK\_RB1@244 -34.10 dBm

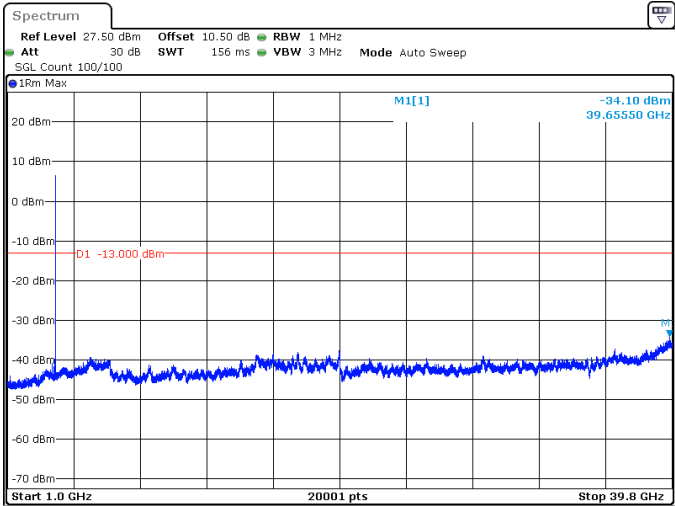


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:16:06

90MHz\_30kHz\_3745MHz\_DFT-s-OFDM QPSK\_RB243@0 -34.96 dBm

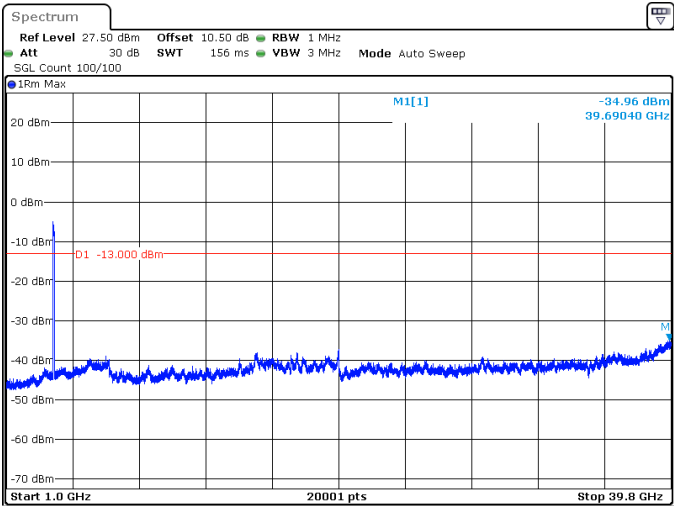


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:17:44

90MHz\_30kHz\_3745MHz\_DFT-s-OFDM QPSK\_RB243@0 -46.80 dBm

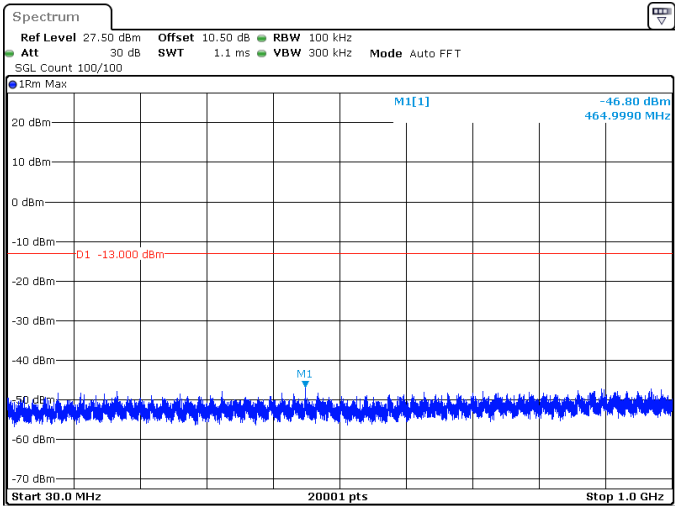


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:16:43

90MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.57 dBm

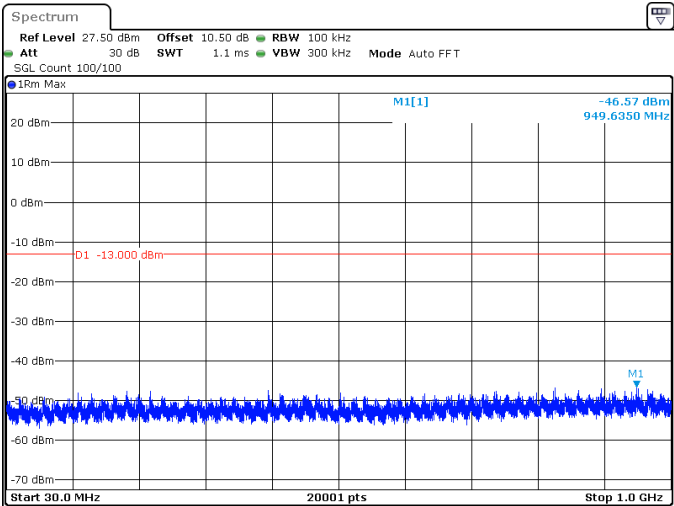


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:18:26

90MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.73 dBm

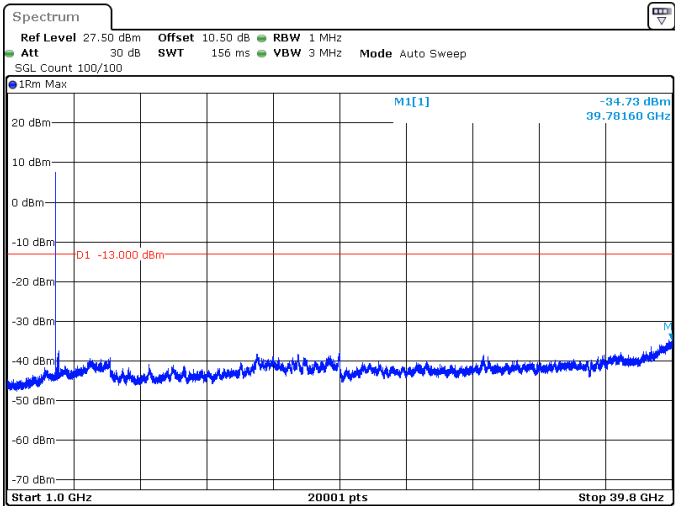


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:19:28

90MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@244 -46.82 dBm

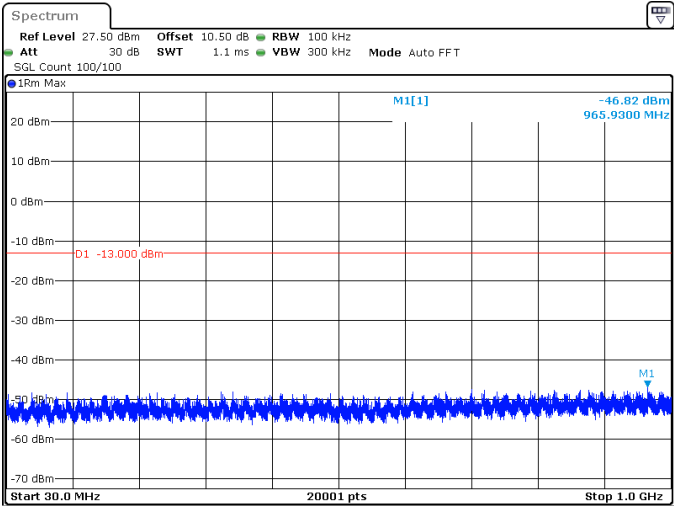


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:20:04

90MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@244 -34.89 dBm

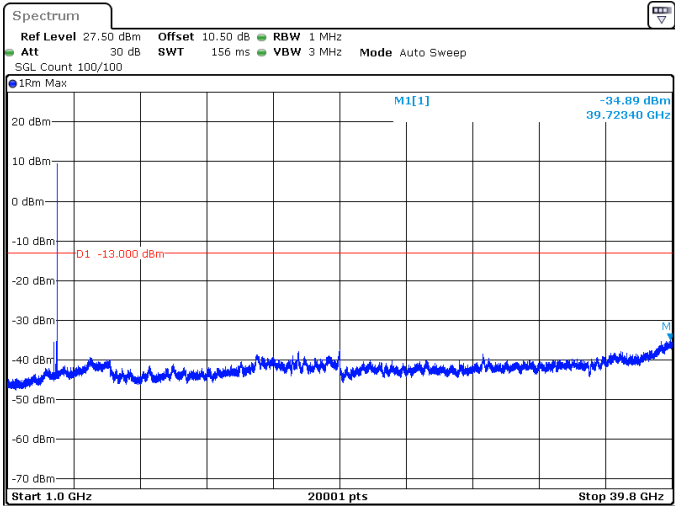


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:21:08

90MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB243@0 -35.18 dBm

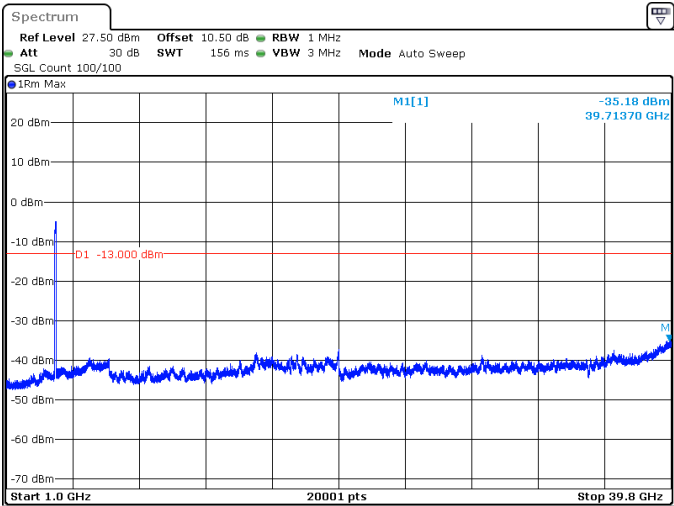


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:22:48

90MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB243@0 -46.61 dBm

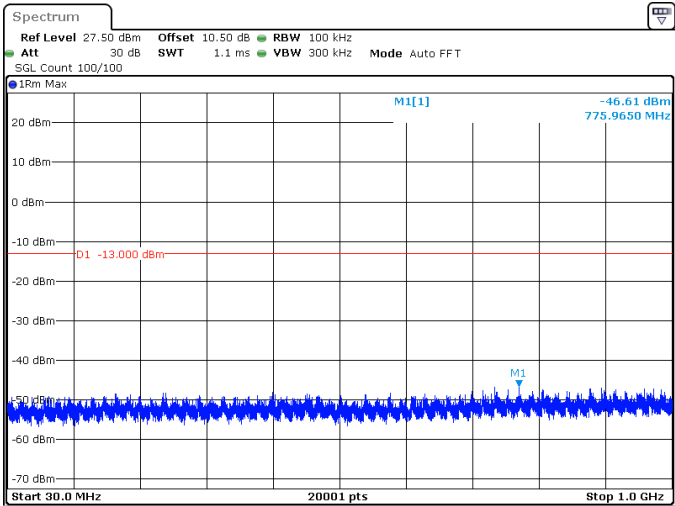


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:21:45

90MHz\_30kHz\_3935MHz\_DFT-s-OFDM QPSK\_RB1@0 -35.45 dBm

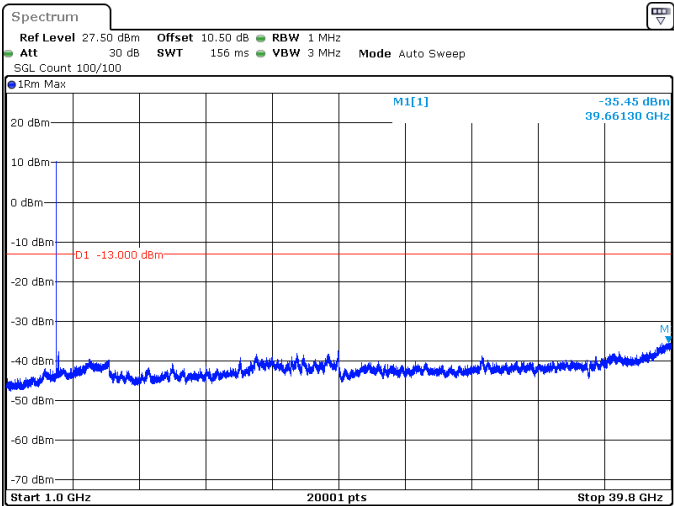


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:24:33

90MHz\_30kHz\_3935MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.86 dBm

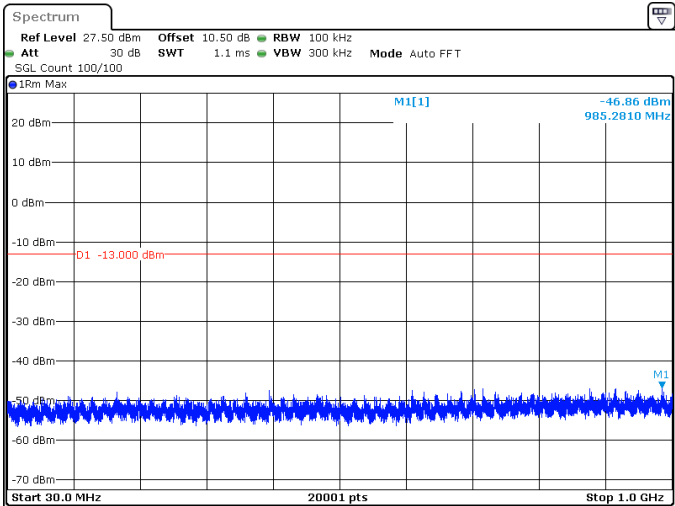


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:23:31

90MHz\_30kHz\_3935MHz\_DFT-s-OFDM QPSK\_RB1@244 -46.00 dBm

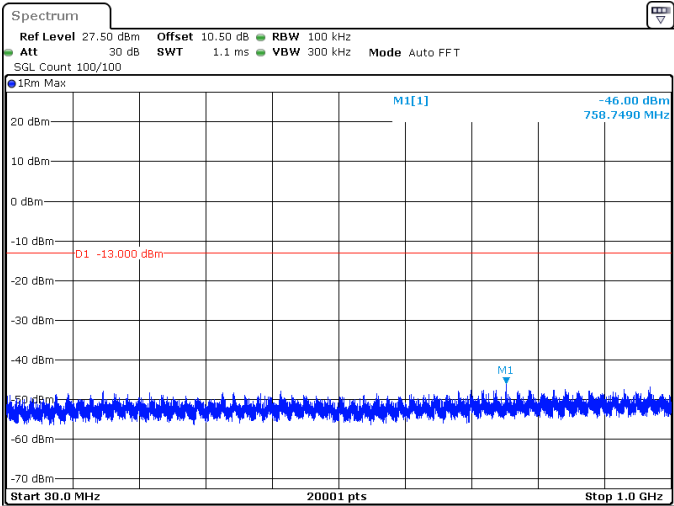


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:25:10

90MHz\_30kHz\_3935MHz\_DFT-s-OFDM QPSK\_RB1@244 -34.45 dBm

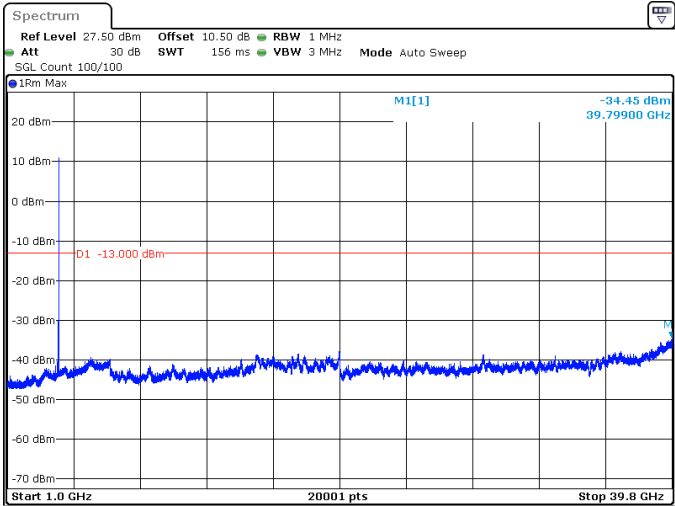


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:26:13

90MHz\_30kHz\_3935MHz\_DFT-s-OFDM QPSK\_RB243@0 -34.54 dBm

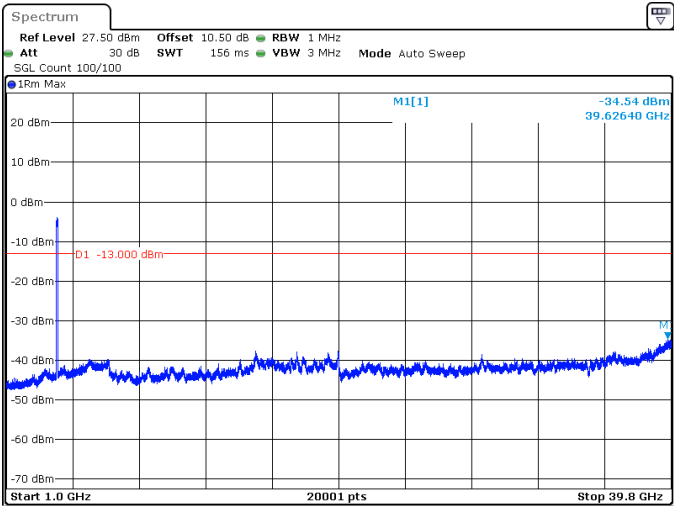


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:27:52

90MHz\_30kHz\_3935MHz\_DFT-s-OFDM QPSK\_RB243@0 -47.38 dBm

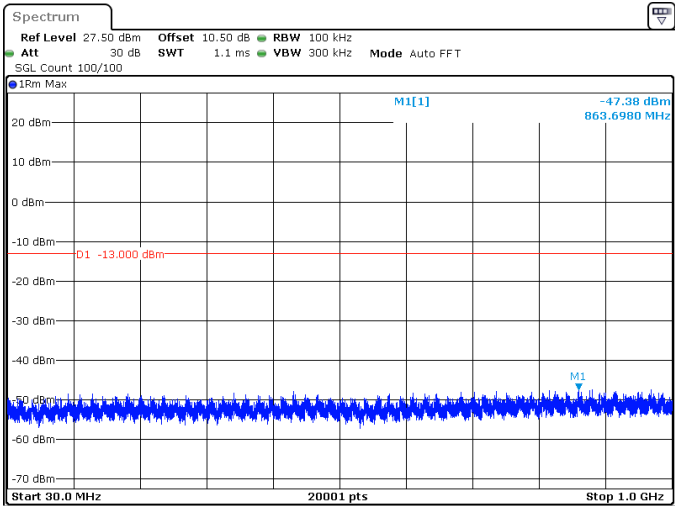


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:26:50

100MHz\_30kHz\_3750MHz\_DFT-s-OFDM QPSK\_RB1@0 -47.12 dBm

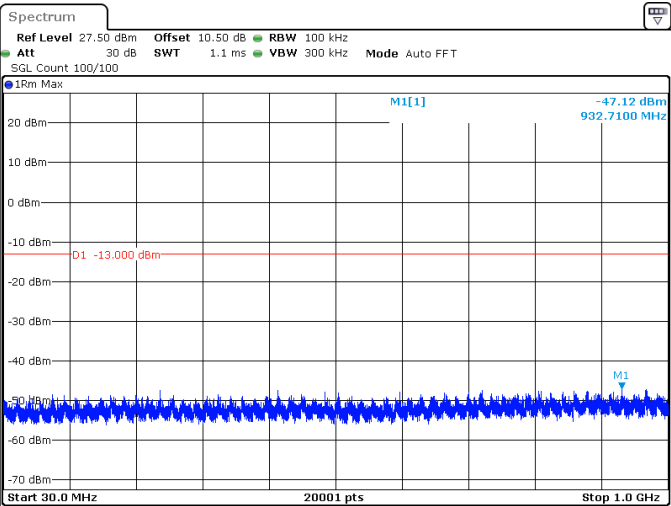


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:28:38

100MHz\_30kHz\_3750MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.46 dBm

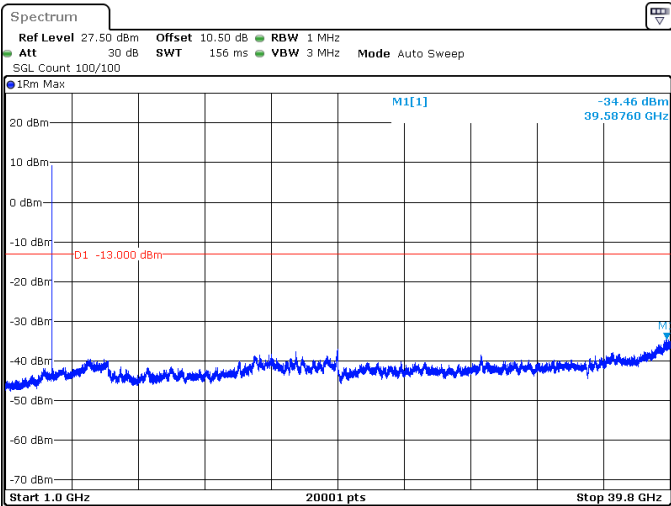


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:29:40

100MHz\_30kHz\_3750MHz\_DFT-s-OFDM QPSK\_RB1@272 -45.75 dBm

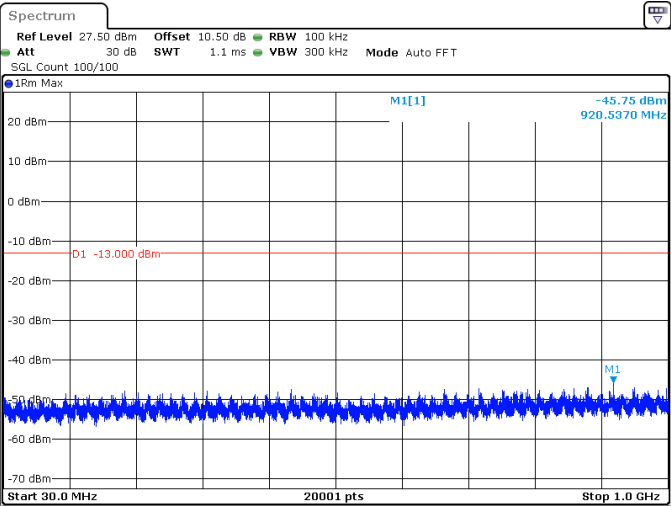


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:30:18

100MHz\_30kHz\_3750MHz\_DFT-s-OFDM QPSK\_RB1@272 -34.69 dBm

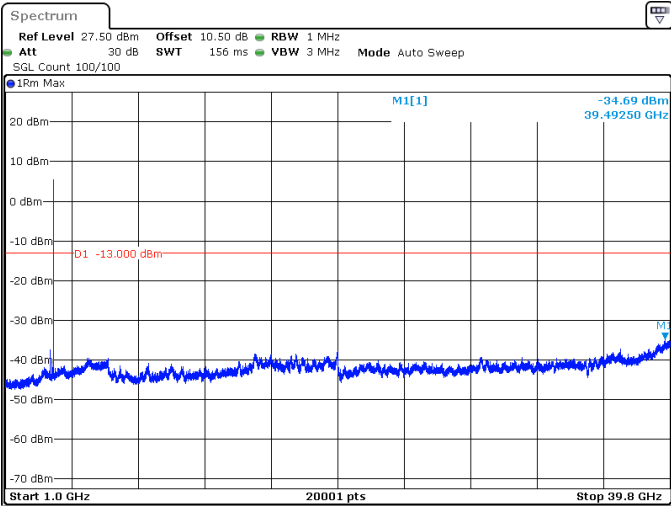


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:31:20

100MHz\_30kHz\_3750MHz\_DFT-s-OFDM QPSK\_RB270@0 -34.76 dBm

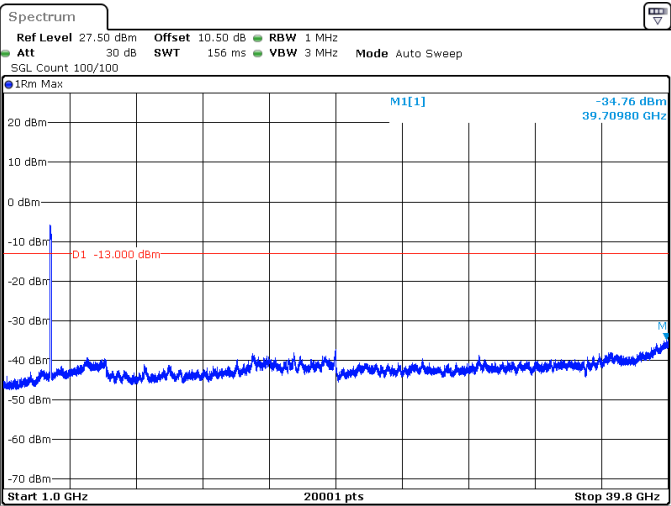


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:33:00

100MHz\_30kHz\_3750MHz\_DFT-s-OFDM QPSK\_RB270@0 -46.44 dBm

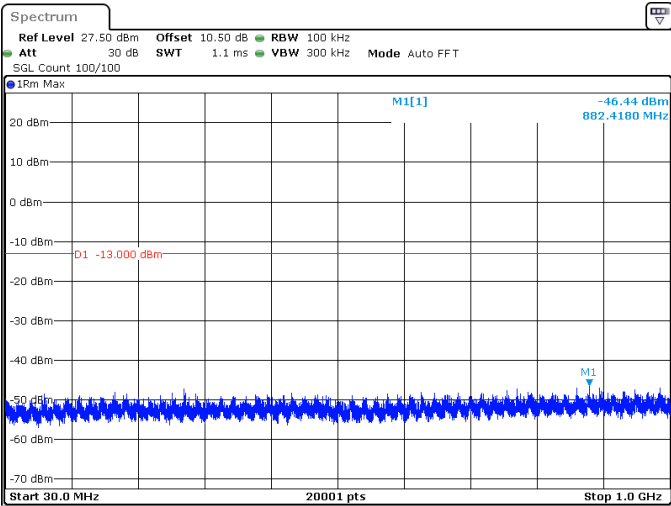


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:31:57

100MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.52 dBm

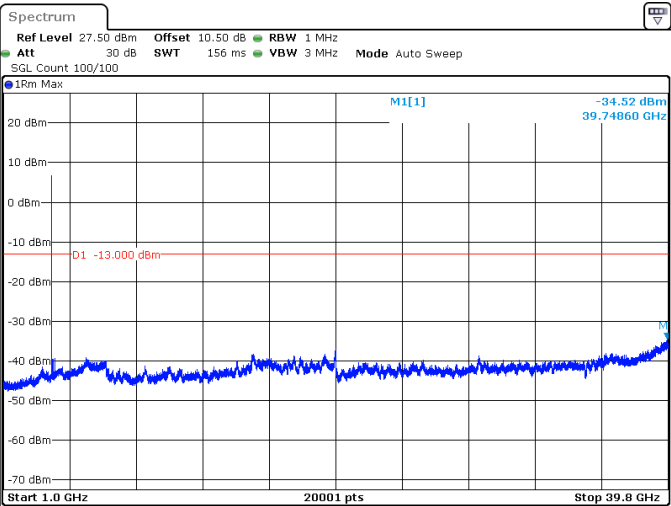


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:34:45

100MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.98 dBm

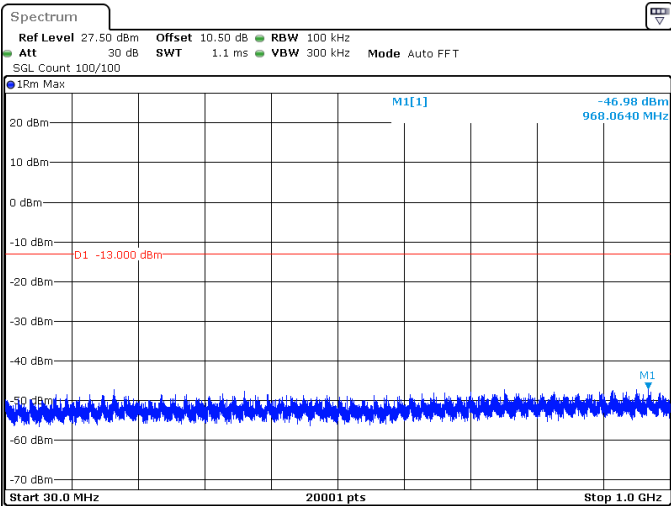


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:33:43

100MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@272 -46.75 dBm

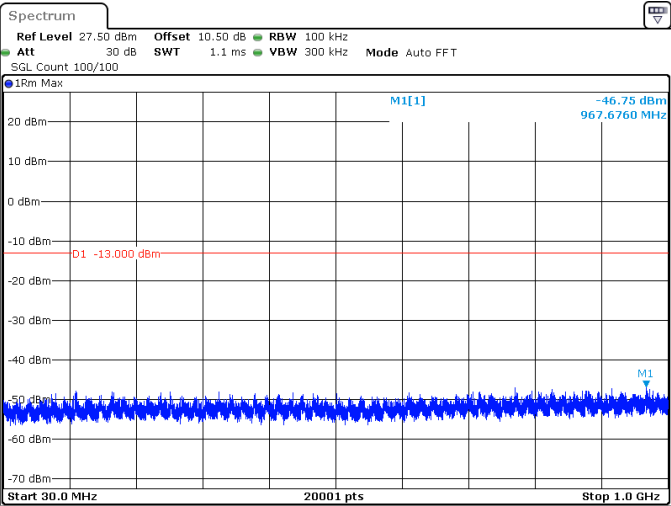


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:35:22

100MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB1@272 -34.86 dBm

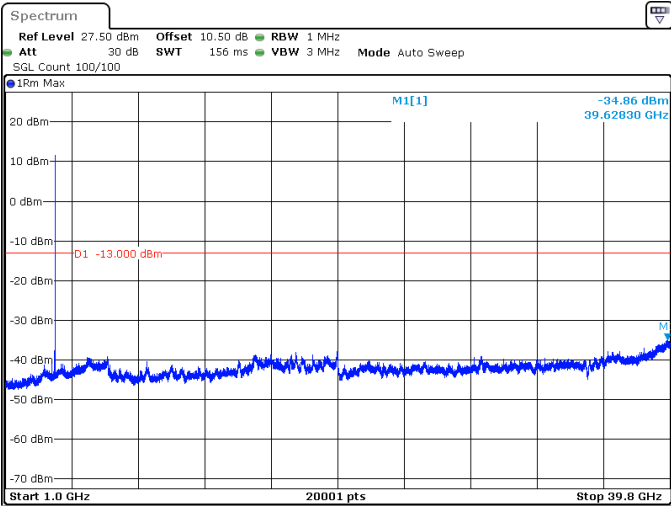


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:36:25

100MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB270@0 -34.93 dBm

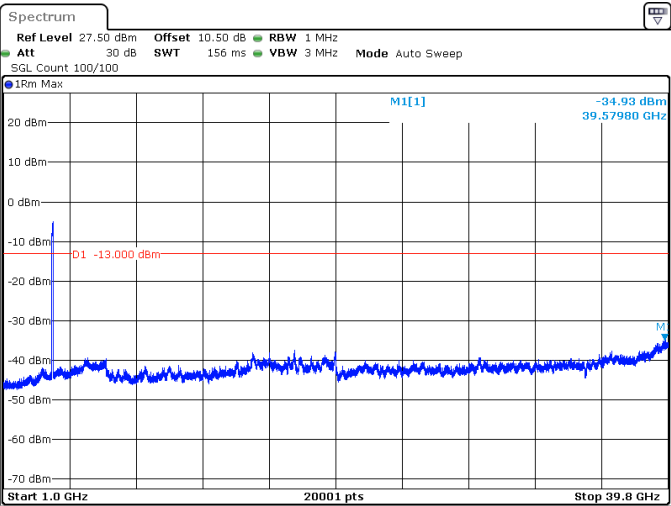


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:38:05

100MHz\_30kHz\_3840MHz\_DFT-s-OFDM QPSK\_RB270@0 -46.49 dBm

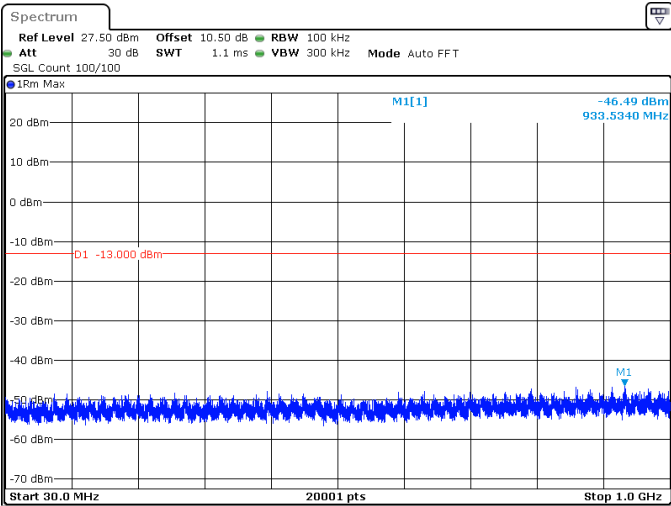


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:37:03

100MHz\_30kHz\_3930MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.54 dBm

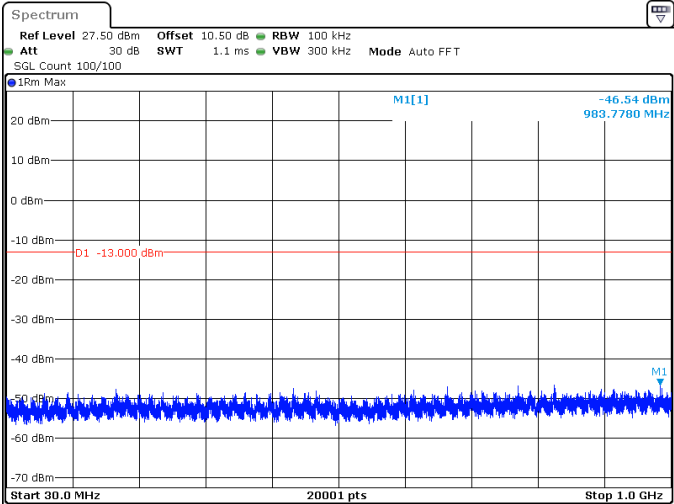


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:38:48

100MHz\_30kHz\_3930MHz\_DFT-s-OFDM QPSK\_RB1@0 -34.78 dBm

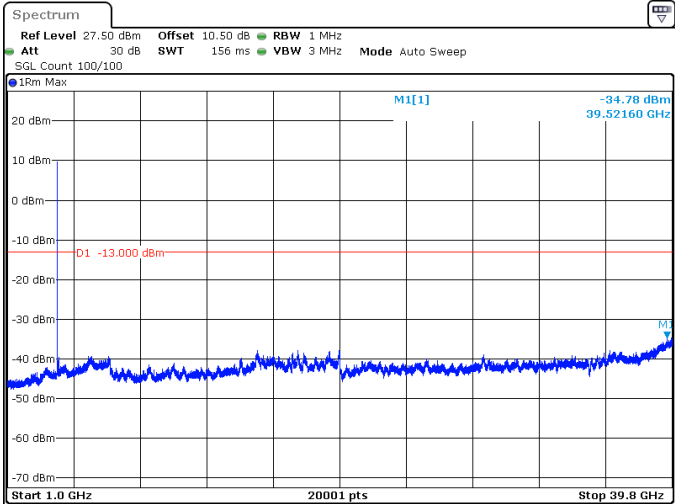


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:39:51

100MHz\_30kHz\_3930MHz\_DFT-s-OFDM QPSK\_RB1@272 -34.42 dBm

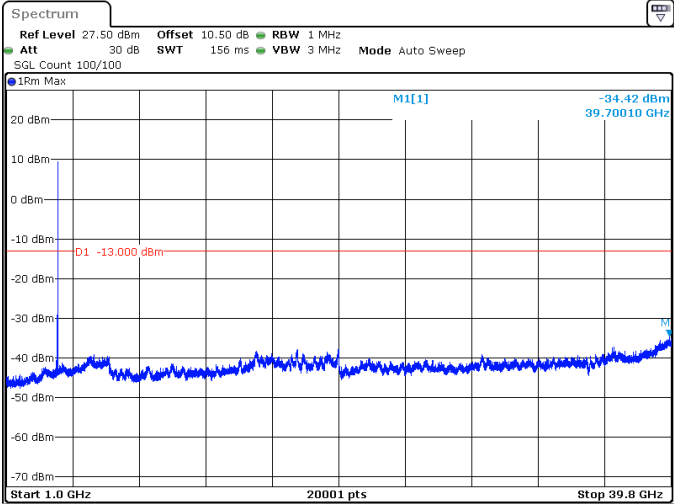


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:41:32

100MHz\_30kHz\_3930MHz\_DFT-s-OFDM QPSK\_RB1@272 -46.45 dBm

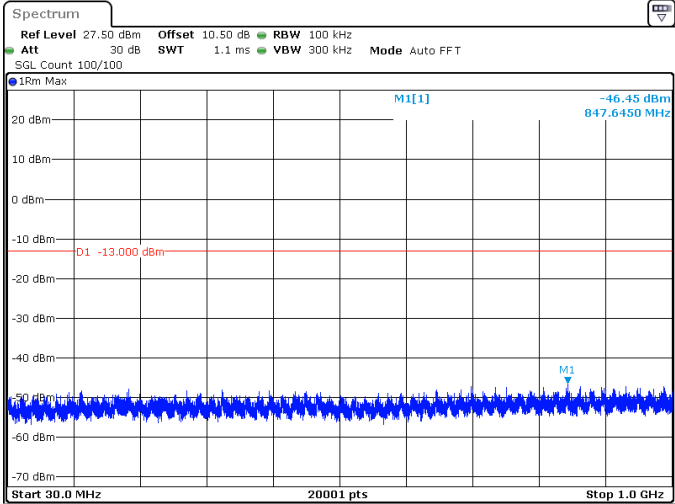


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:40:30

100MHz\_30kHz\_3930MHz\_DFT-s-OFDM QPSK\_RB270@0 -46.60 dBm

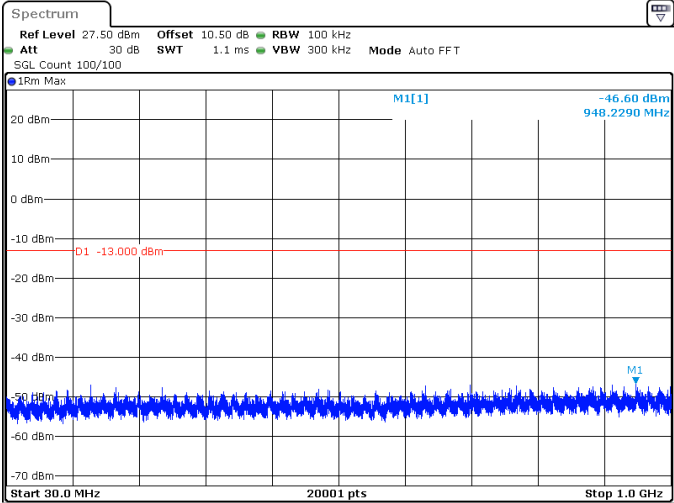

ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:42:10


100MHz\_30kHz\_3930MHz\_DFT-s-OFDM QPSK\_RB270@0 -34.96 dBm

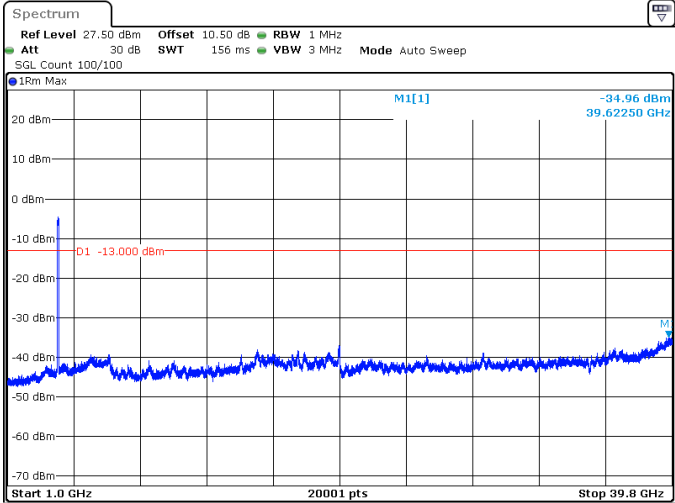

ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 18.MAR.2024 13:43:12


n78\_1

10MHz\_30kHz\_3455MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.70 dBm

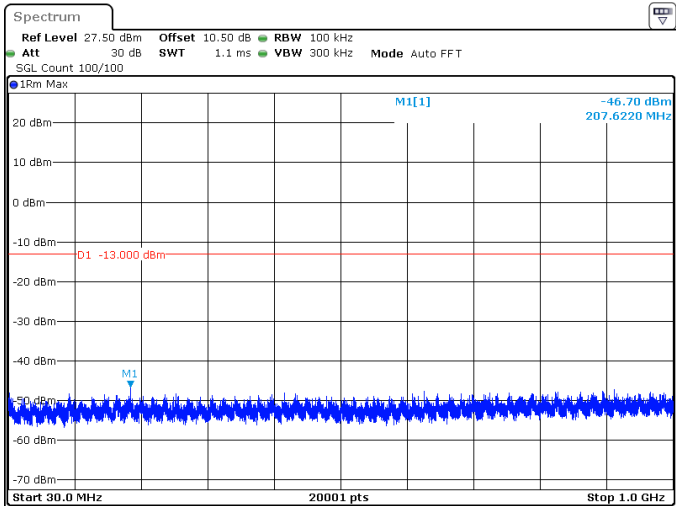


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:02:44

10MHz\_30kHz\_3455MHz\_DFT-s-OFDM QPSK\_RB1@0 -37.63 dBm

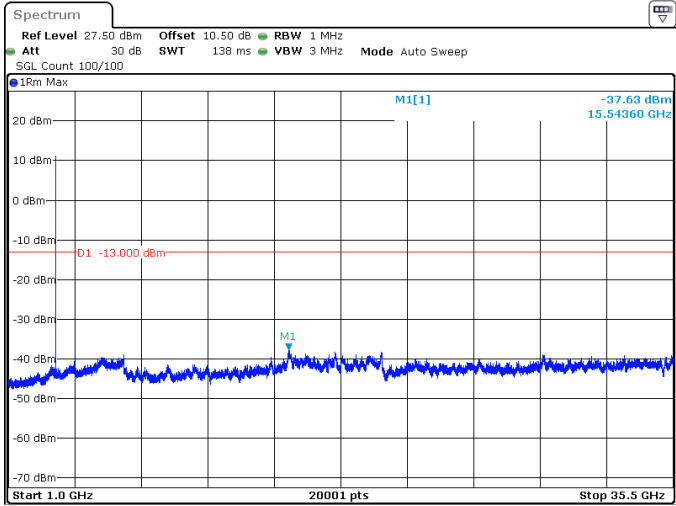


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:03:41

10MHz\_30kHz\_3455MHz\_DFT-s-OFDM QPSK\_RB1@23 -46.92 dBm

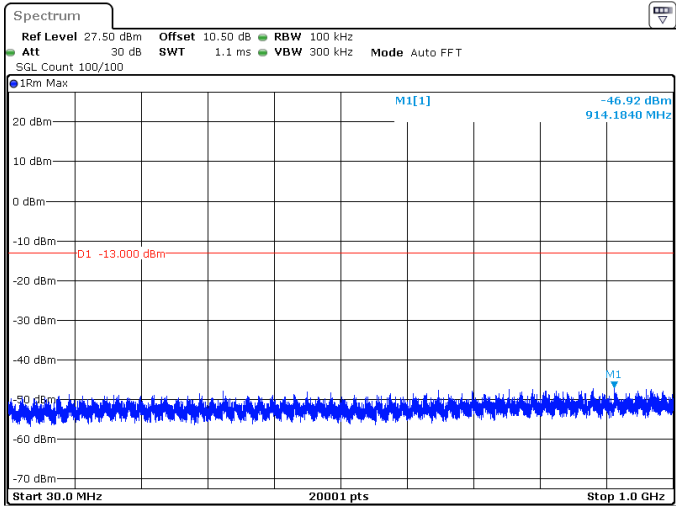


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:04:14

10MHz\_30kHz\_3455MHz\_DFT-s-OFDM QPSK\_RB1@23 -37.28 dBm

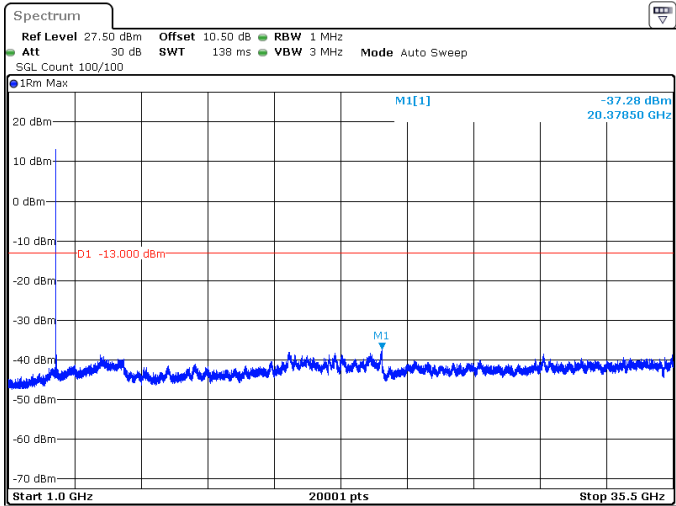


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:05:11

10MHz\_30kHz\_3455MHz\_DFT-s-OFDM QPSK\_RB24@0 -37.45 dBm

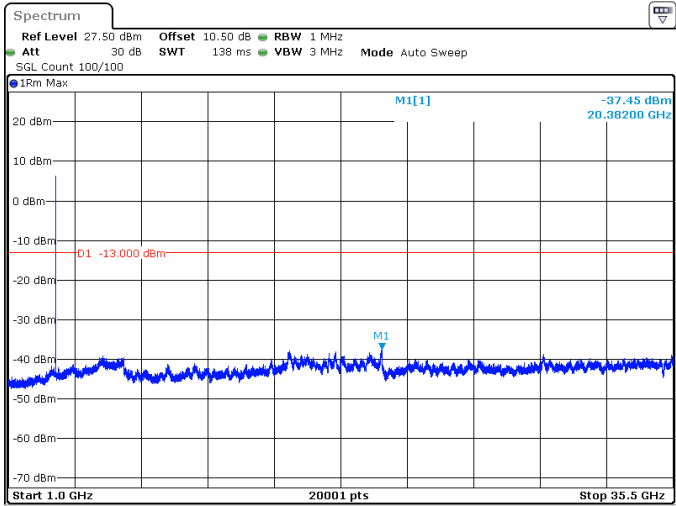


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:06:40

10MHz\_30kHz\_3455MHz\_DFT-s-OFDM QPSK\_RB24@0 -47.08 dBm

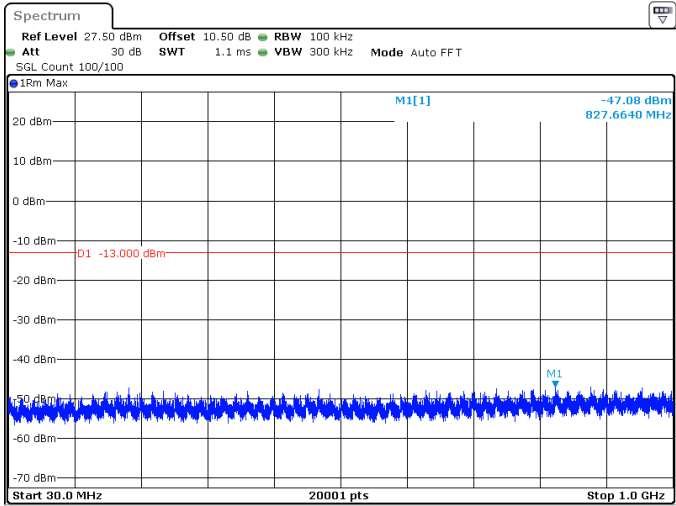


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:05:42

10MHz\_30kHz\_3500MHz\_DFT-s-OFDM QPSK\_RB1@0 -37.47 dBm

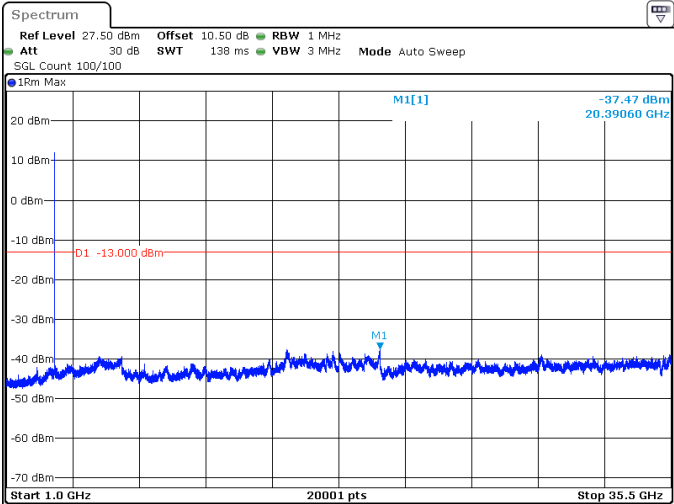


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:08:12

10MHz\_30kHz\_3500MHz\_DFT-s-OFDM QPSK\_RB1@0 -46.53 dBm

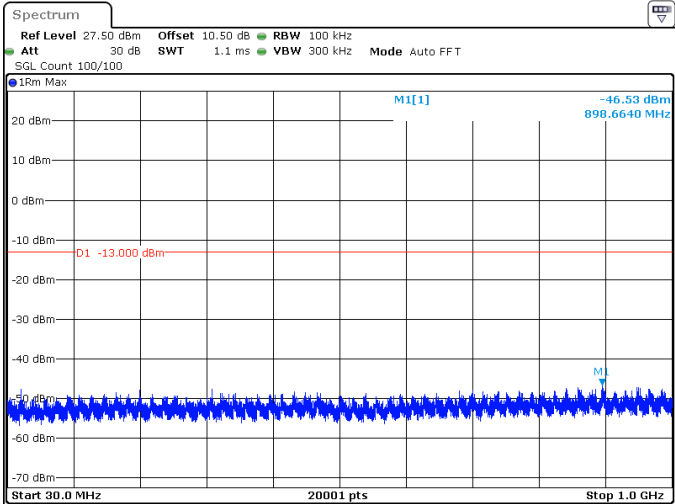


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:07:15

10MHz\_30kHz\_3500MHz\_DFT-s-OFDM QPSK\_RB1@23 -46.63 dBm

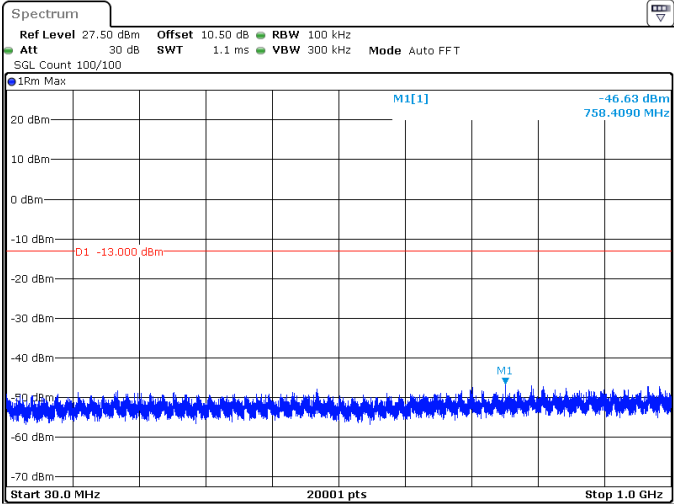


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:08:43

10MHz\_30kHz\_3500MHz\_DFT-s-OFDM QPSK\_RB1@23 -36.40 dBm

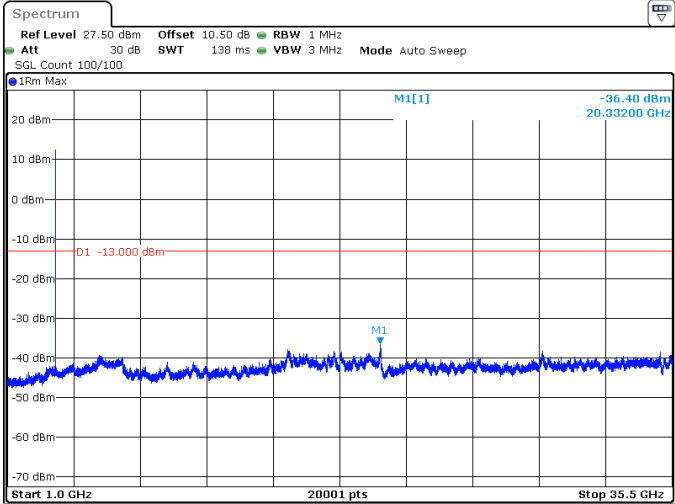


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:09:41

10MHz\_30kHz\_3500MHz\_DFT-s-OFDM QPSK\_RB24@0 -36.96 dBm

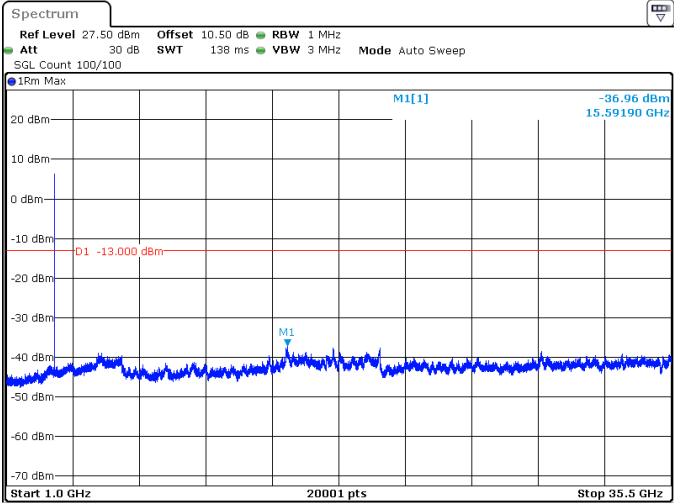

ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:11:09

10MHz\_30kHz\_3500MHz\_DFT-s-OFDM QPSK\_RB24@0 -46.76 dBm

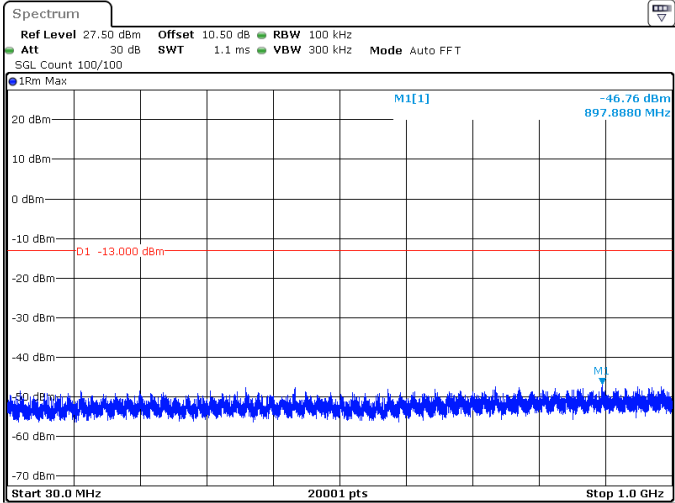

ProjectNo.:SZ1240108-01736E Tester:Jim Cheng  
Date: 17.MAR.2024 13:10:12