

Spurious Emissions at Antenna Terminal

FCC Part 96

n77_2

Mode	Value (dBm)	Limit	Result
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-47.04	-40	Pass
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@23	-47.76	-40	Pass
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-48.17	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.87	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@23	-47.89	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB24@0	-47.95	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@0	-47.95	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-47.33	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-48.15	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-48.10	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@37	-47.71	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-47.77	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.89	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@37	-47.69	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB36@0	-47.62	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@0	-47.82	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-47.63	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-47.93	-40	Pass

Mode	Value (dBm)	Limit	Result
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-47.70	-40	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@50	-47.92	-40	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-47.61	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.79	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@50	-47.52	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB50@0	-48.01	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@0	-47.79	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-47.61	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-47.77	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-47.71	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@77	-47.90	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-47.68	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-48.31	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@77	-48.11	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB75@0	-47.86	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@0	-47.81	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-47.04	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-47.89	-40	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-48.10	-40	Pass

Mode	Value (dBm)	Limit	Result
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-47.68	-40	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@105	-47.98	-40	Pass
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB100@0	-47.86	-40	Pass
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.72	-40	Pass
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@105	-47.60	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-47.81	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@0	-46.99	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-47.72	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-47.45	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-47.12	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@132	-47.82	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB128@0	-48.23	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.93	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@132	-48.04	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-48.19	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@0	-47.56	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-47.40	-40	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-47.98	-40	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-47.22	-40	Pass

Mode	Value (dBm)	Limit	Result
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@161	-47.62	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB162@0	-48.13	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.70	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@161	-47.52	-40	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-48.33	-40	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@0	-47.80	-40	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-48.12	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-48.21	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-46.94	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@188	-47.82	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB180@0	-47.27	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.63	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@188	-47.87	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-47.76	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@0	-47.88	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-47.38	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-45.69	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@216	-47.92	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-48.15	-40	Pass

Mode	Value (dBm)	Limit	Result
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-46.83	-40	Pass
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@216	-47.81	-40	Pass
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB216@0	-47.84	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@0	-47.80	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-47.85	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-47.71	-40	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-47.82	-40	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@244	-47.37	-40	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-46.98	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-48.20	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@244	-47.19	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB243@0	-47.93	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@0	-47.67	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-48.02	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-48.14	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-48.26	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@272	-47.82	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-47.70	-40	Pass
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.39	-40	Pass

Mode	Value (dBm)	Limit	Result
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@272	-47.25	-40	Pass
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB270@0	-48.21	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@0	-47.29	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-48.11	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-47.46	-40	Pass

n78_2

Mode	Value (dBm)	Limit	Result
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-47.45	-40	Pass
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@23	-47.82	-40	Pass
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-47.90	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-48.23	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@23	-47.19	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB24@0	-47.64	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@0	-47.95	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-47.87	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-48.19	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-47.78	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@37	-48.03	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-48.28	-40	Pass

Mode	Value (dBm)	Limit	Result
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.96	-40	Pass
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@37	-48.10	-40	Pass
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB36@0	-47.39	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@0	-47.38	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-48.03	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-46.92	-40	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-48.11	-40	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@50	-48.04	-40	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-47.91	-40	Pass
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-48.27	-40	Pass
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@50	-47.80	-40	Pass
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB50@0	-48.05	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@0	-47.42	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-47.42	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-47.80	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-47.70	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@77	-47.50	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-47.64	-40	Pass
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.43	-40	Pass

Mode	Value (dBm)	Limit	Result
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@77	-47.91	-40	Pass
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB75@0	-47.90	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@0	-47.54	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-47.46	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-47.49	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-47.44	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-47.62	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@105	-46.95	-40	Pass
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB100@0	-47.56	-40	Pass
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.91	-40	Pass
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@105	-48.06	-40	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-47.71	-40	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@0	-48.16	-40	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-48.03	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-47.52	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-48.03	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@132	-47.51	-40	Pass
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB128@0	-47.67	-40	Pass
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.90	-40	Pass


Mode	Value (dBm)	Limit	Result
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@132	-48.13	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-47.32	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@0	-47.85	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-47.52	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-46.89	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-47.58	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@161	-47.83	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB162@0	-47.65	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.80	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@161	-47.85	-40	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-47.70	-40	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@0	-47.51	-40	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-47.65	-40	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-47.95	-40	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-48.08	-40	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@188	-48.44	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB180@0	-47.46	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.35	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@188	-47.96	-40	Pass

Mode	Value (dBm)	Limit	Result
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-47.55	-40	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@0	-47.30	-40	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-47.97	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-47.74	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@216	-47.83	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-47.28	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-48.02	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@216	-47.70	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB216@0	-47.66	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@0	-47.20	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-47.10	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-47.64	-40	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-47.97	-40	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@244	-47.99	-40	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-48.25	-40	Pass
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.08	-40	Pass
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@244	-47.95	-40	Pass
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB243@0	-48	-40	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@0	-47.42	-40	Pass

Mode	Value (dBm)	Limit	Result
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-48.16	-40	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-48.08	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-47.86	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@272	-47.55	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-47.99	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.68	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@272	-48.18	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB270@0	-47.80	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@0	-47.59	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-47.40	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-48.20	-40	Pass


n77_2

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@0 -47.04dBm

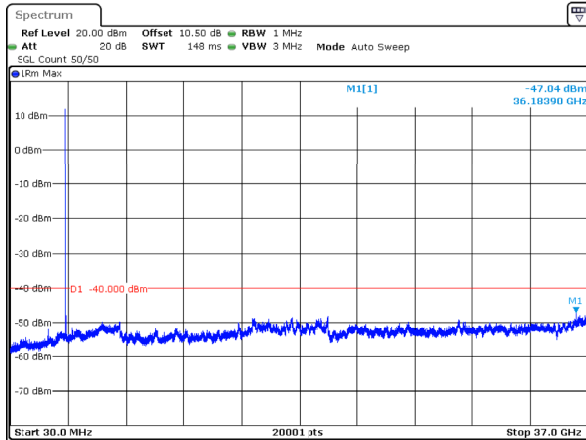


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:45:16

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@23 -47.76dBm

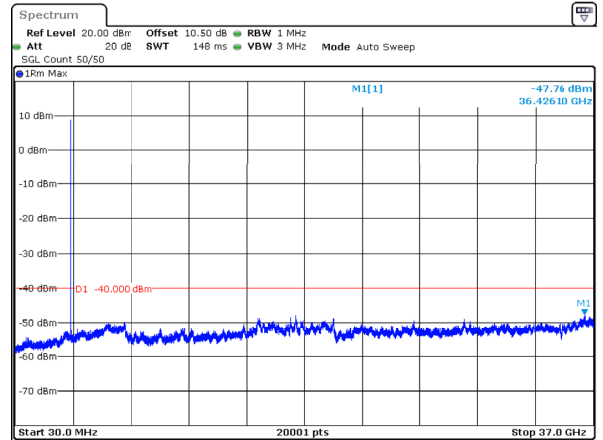


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:42:09

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB24@0 -48.17dBm

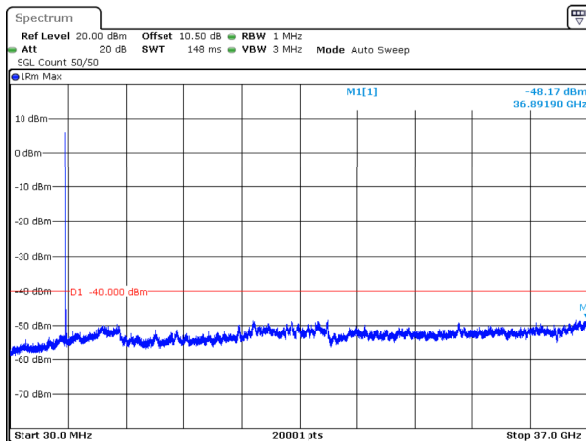


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:45:33

n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.87dBm

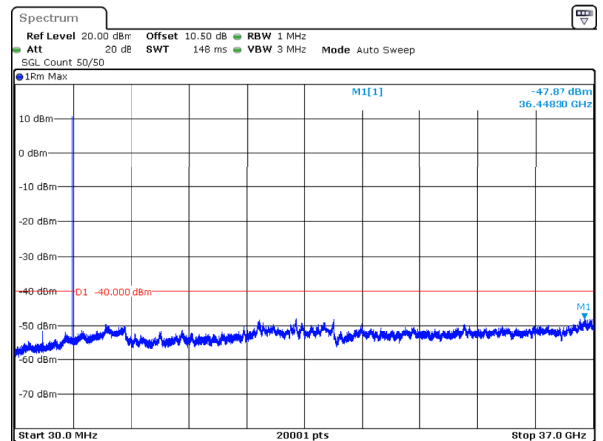


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:47:13

n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@23 -47.89dBm

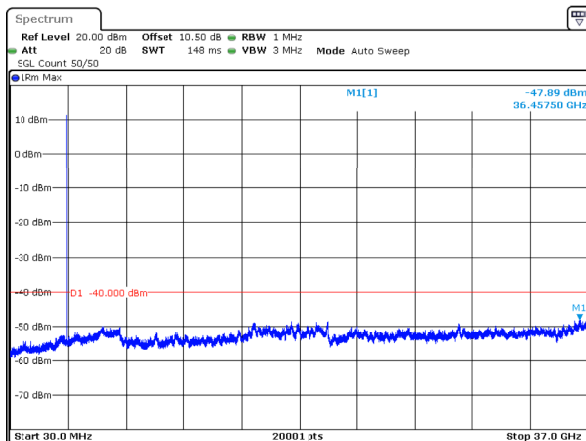


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:48:31

n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB24@0 -47.95dBm

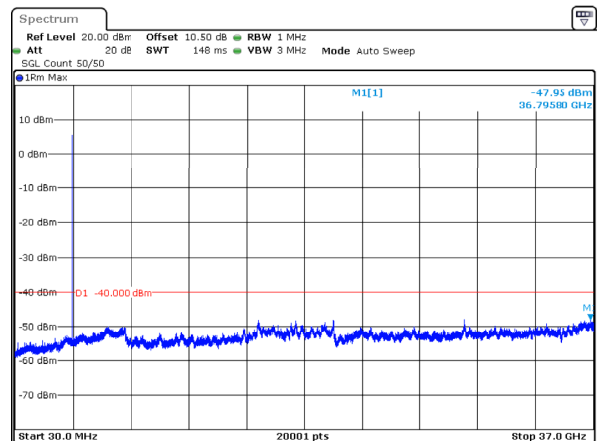


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:49:48

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@0 -47.95dBm

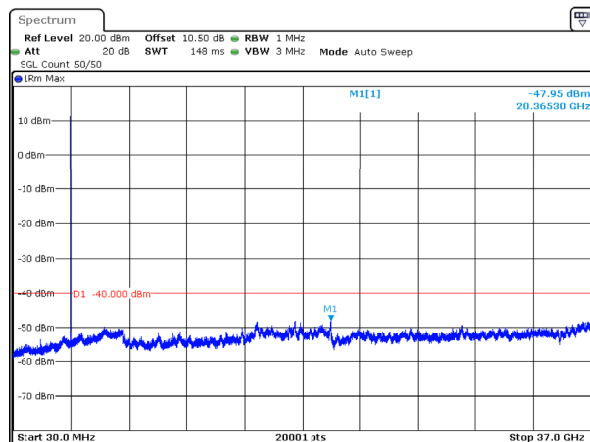


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:51:10

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23 -47.33dBm

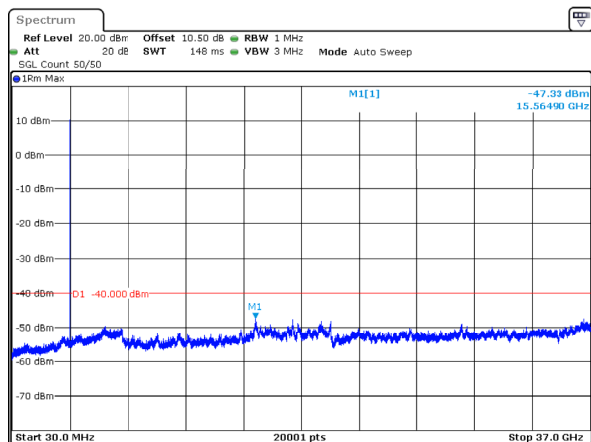


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:52:22

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB24@0 -48.15dBm

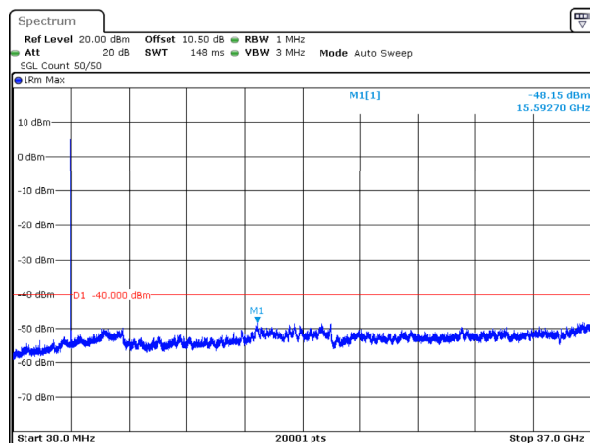


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:53:37

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0 -48.10dBm

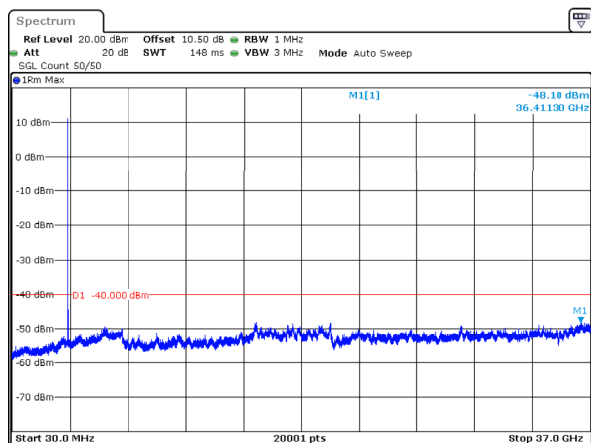


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:55:10

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@37 -47.71dBm

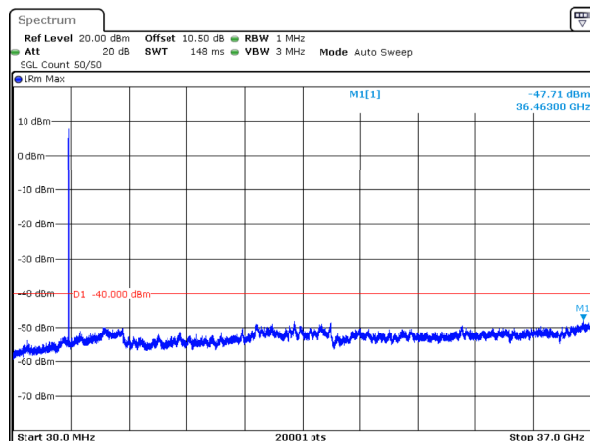


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:56:26

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0 -47.77dBm

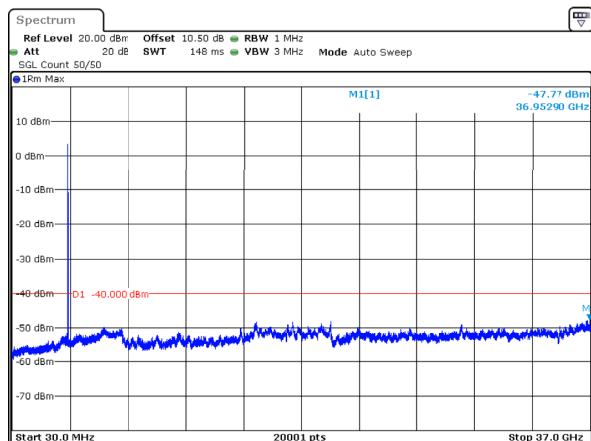


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:57:53

n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.89dBm

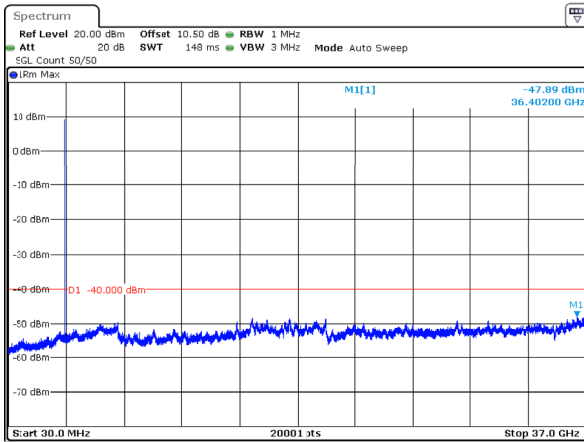


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 16:59:24

n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@37 -47.69dBm

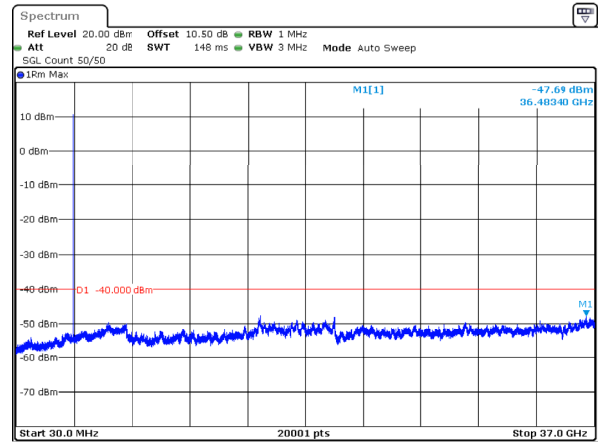


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 17:00:58

n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB36@0 -47.62dBm

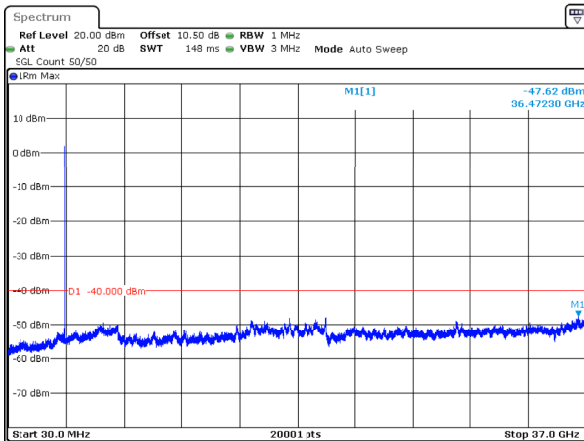


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 31.JUL.2024 17:07:11

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@0 -47.82dBm

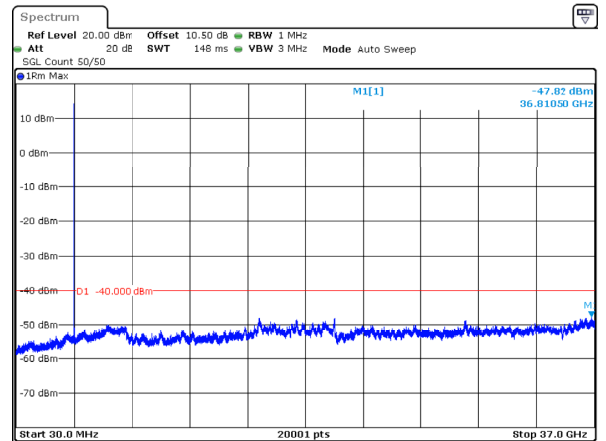


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 09:49:46

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@37 -47.63dBm

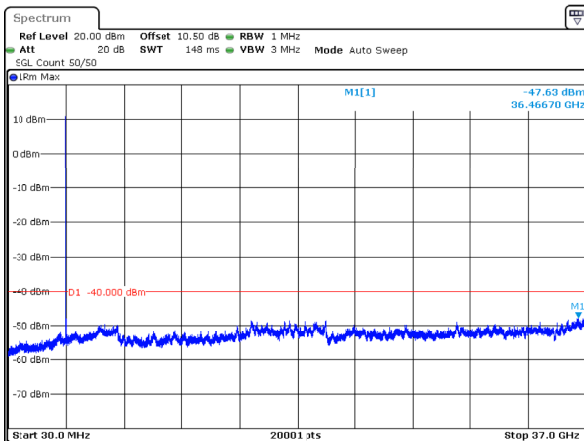


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 09:50:53

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB36@0 -47.93dBm

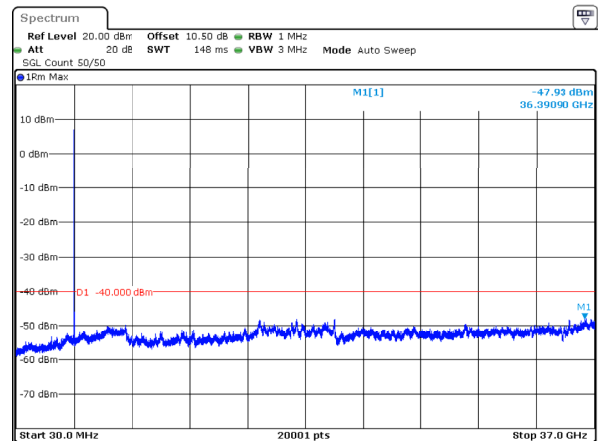


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 09:52:01

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@0 -47.70dBm

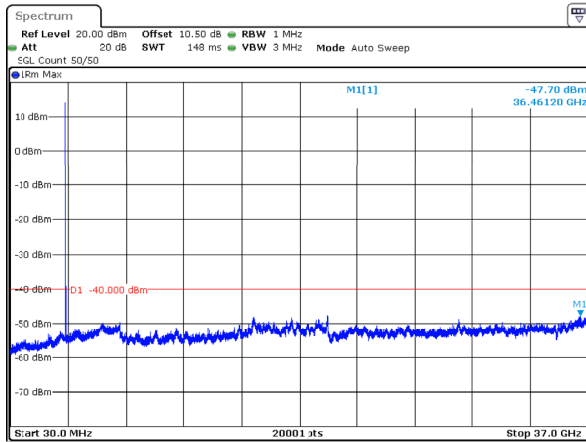


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 09:53:17

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@50 -47.92dBm

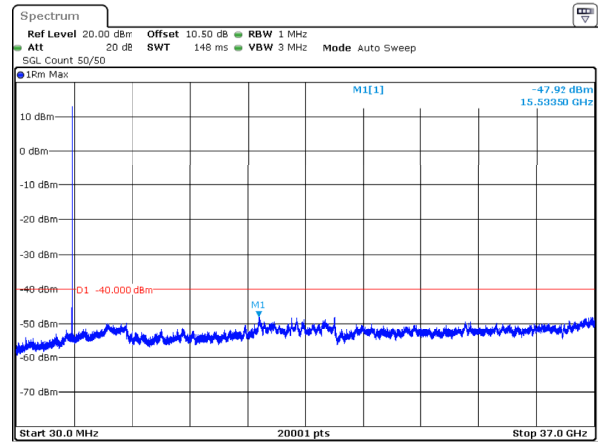


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 09:54:27

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB50@0 -47.61dBm

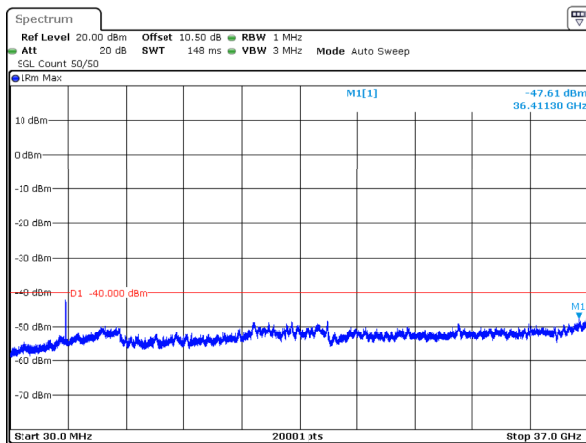


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 09:55:38

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.79dBm

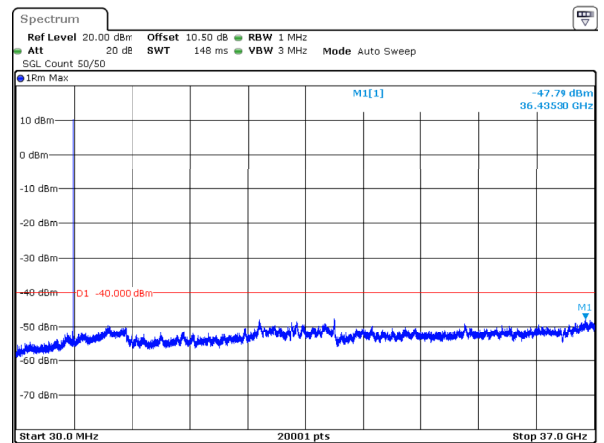


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 09:56:55

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@50 -47.52dBm

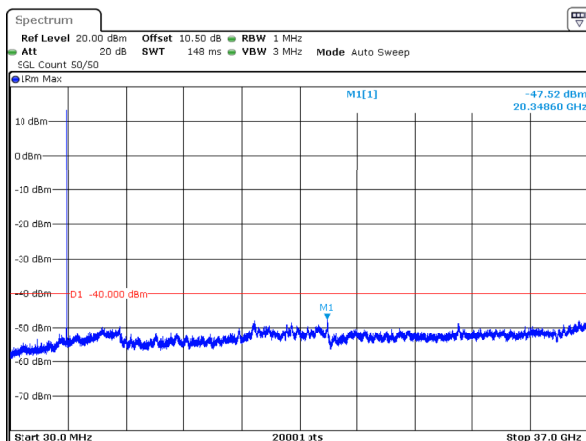


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 09:58:05

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB50@0 -48.01dBm

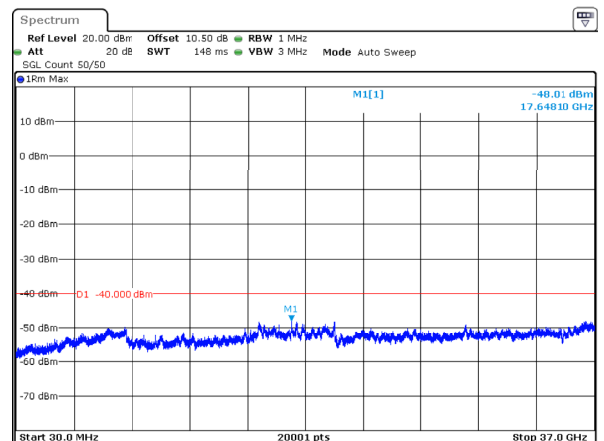


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 09:59:15

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@0 -47.79dBm

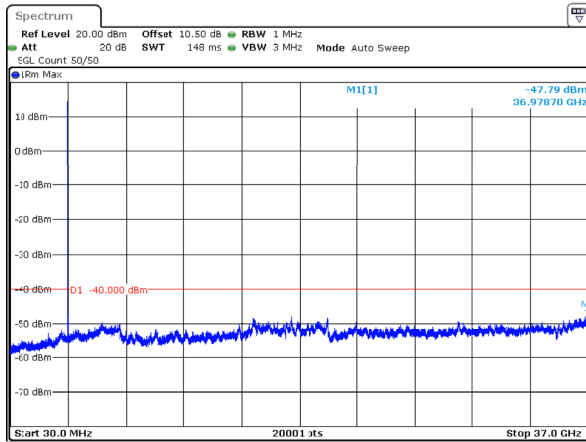


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:00:35

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@50 -47.61dBm

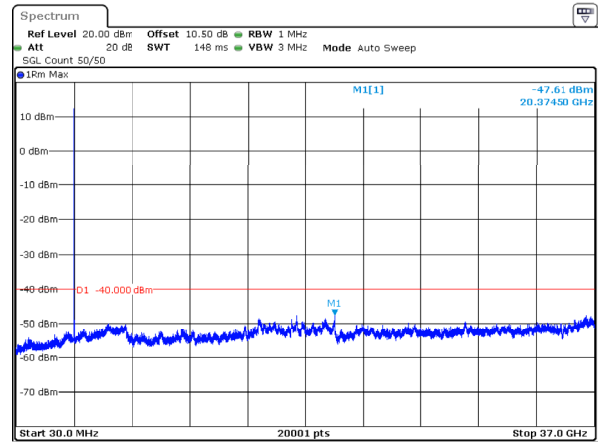


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:01:46

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB50@0 -47.77dBm

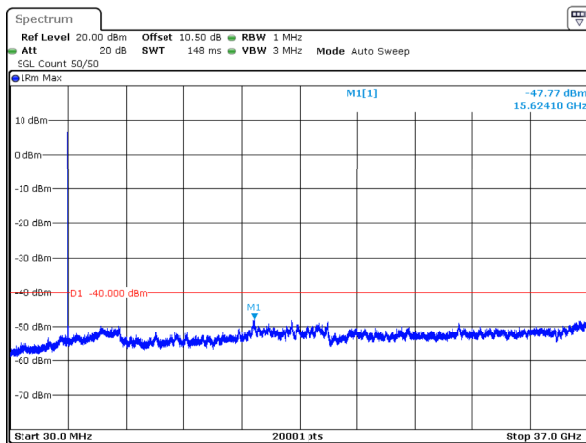


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:02:56

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@0 -47.71dBm

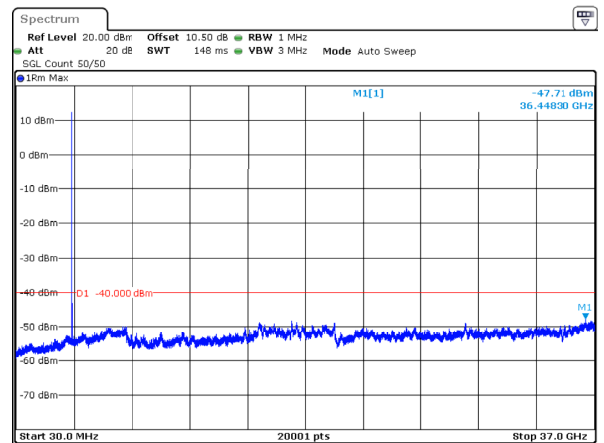


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:04:06

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@77 -47.90dBm

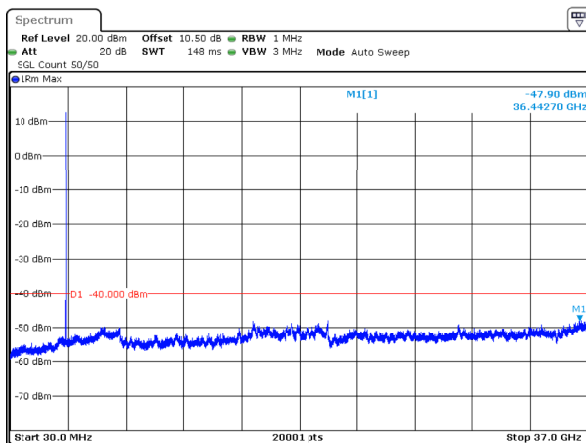


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:05:17

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB75@0 -47.68dBm

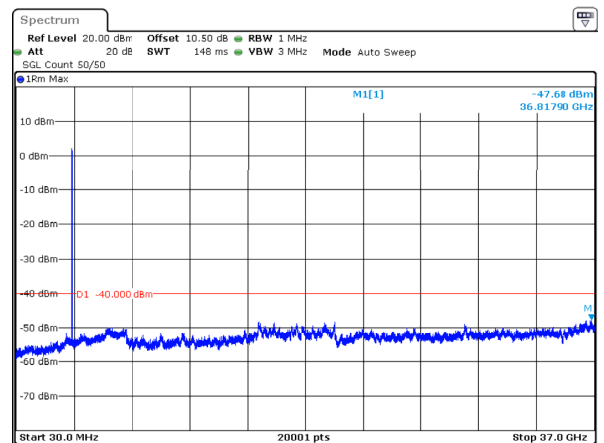


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:06:28

n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -48.31dBm

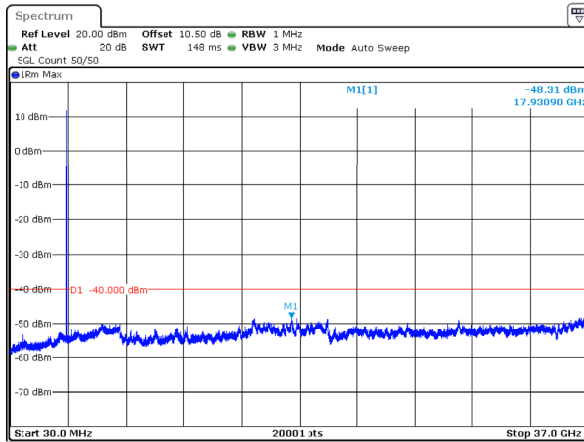


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:07:49

n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@77 -48.11dBm

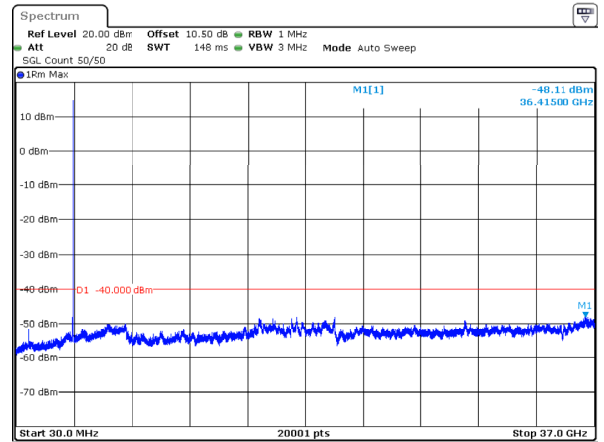


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:08:56

n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB75@0 -47.86dBm

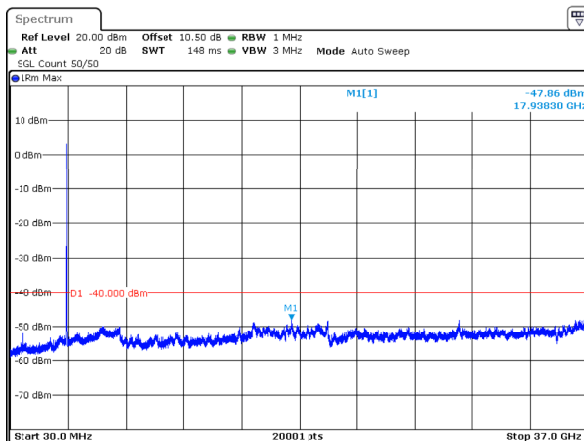


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:10:06

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@0 -47.81dBm

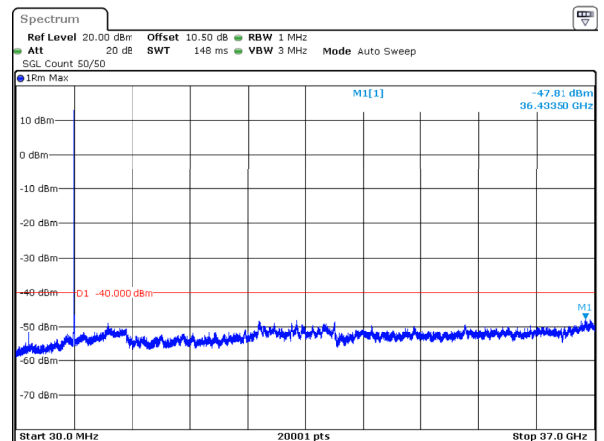


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:11:23

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@77 -47.04dBm

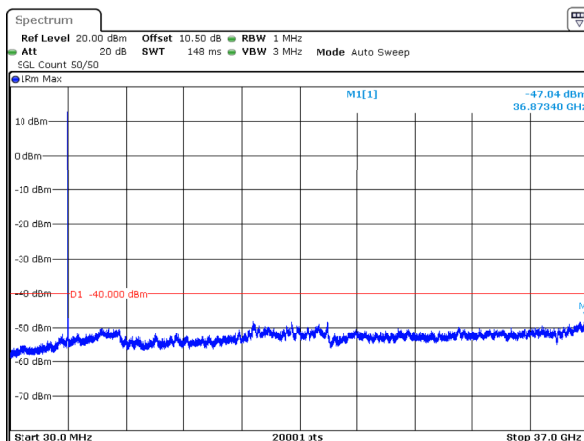


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:12:34

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB75@0 -47.89dBm

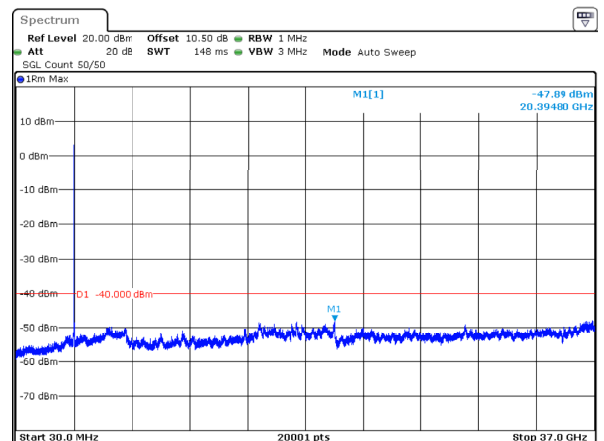


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:13:44

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0 -48.10dBm

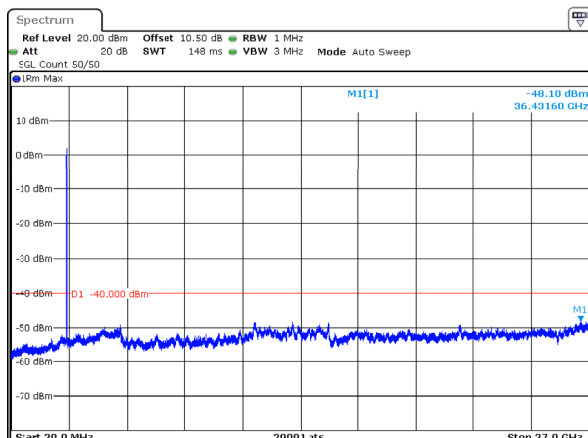


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:17:17

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@0 -47.68dBm

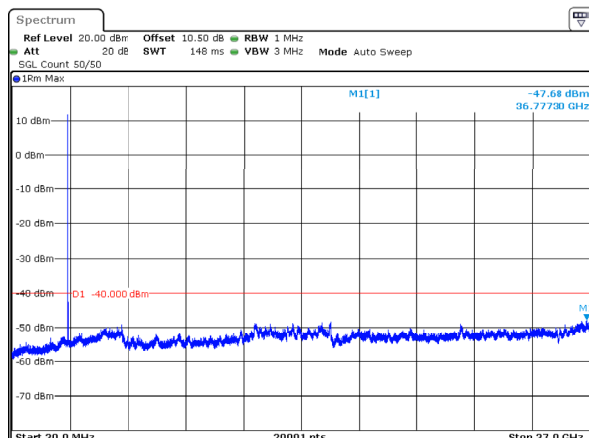


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:14:55

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@105 -47.98dBm

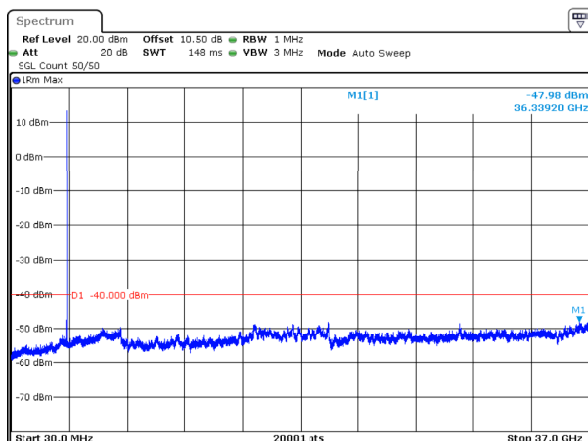


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:16:06

n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB100@0 -47.86dBm

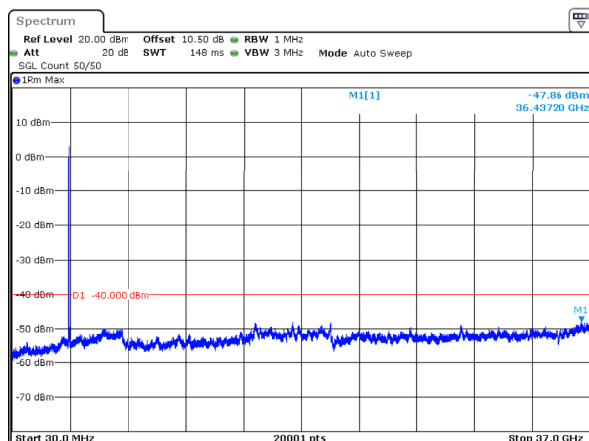


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:21:08

n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.72dBm

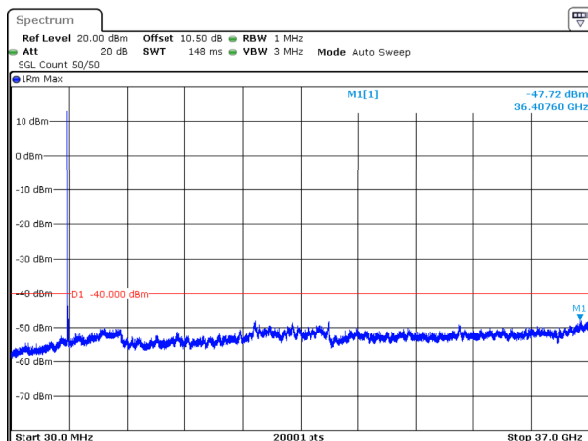


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:18:46

n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@105 -47.60dBm

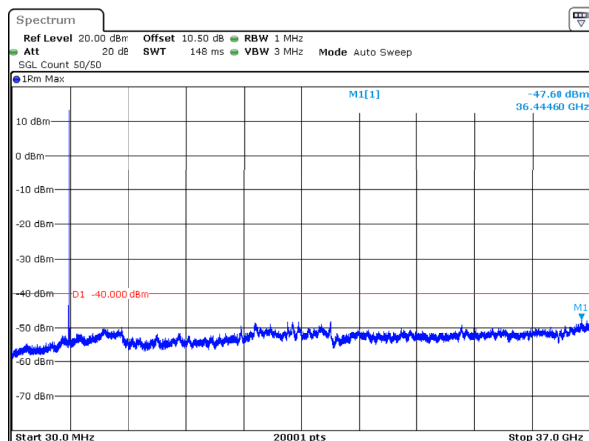


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:19:57

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0 -47.81dBm

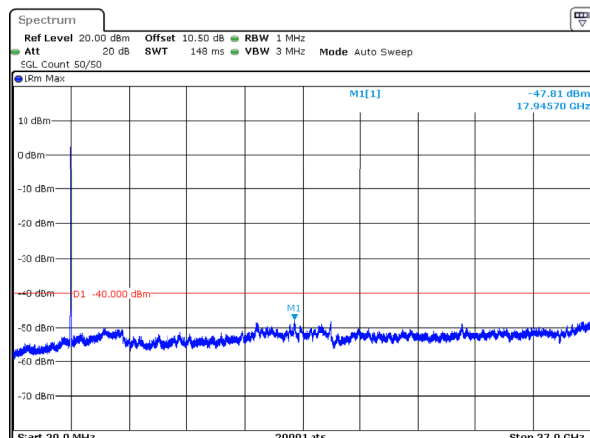


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:24:45

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@0 -46.99dBm

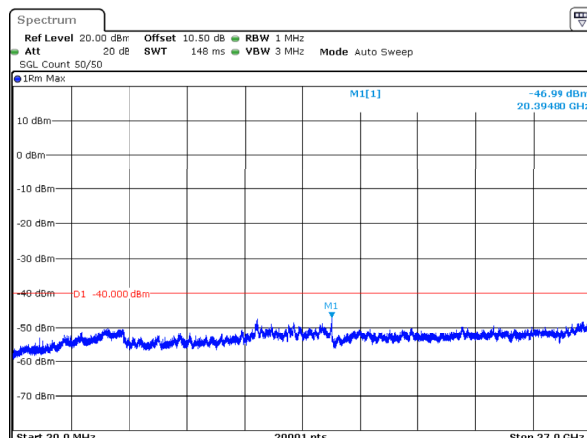


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:22:24

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105 -47.72dBm

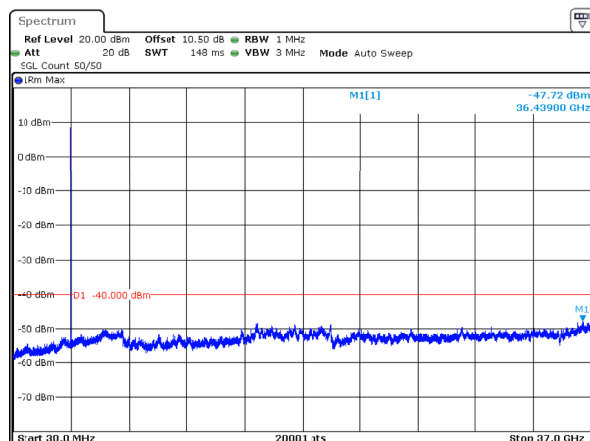


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:23:35

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0 -47.45dBm

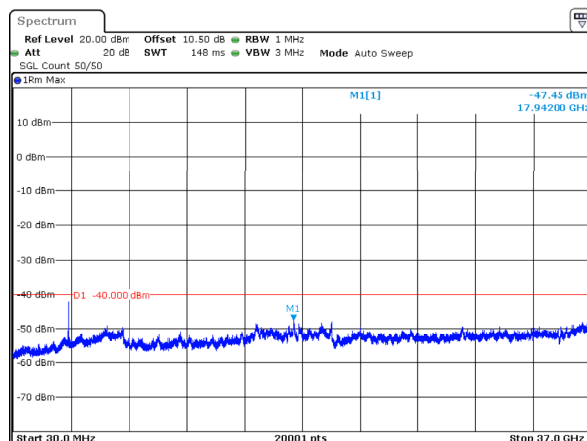


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:28:20

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@0 -47.12dBm

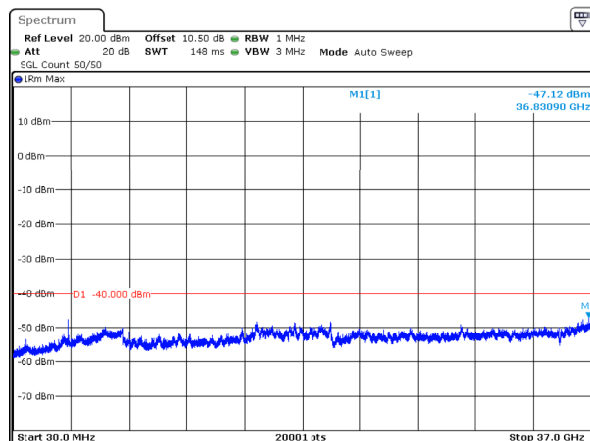


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:25:57

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@132 -47.82dBm

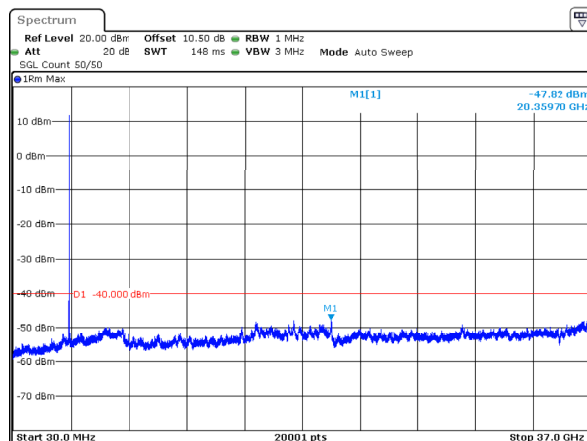


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:27:08

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB128@0 -48.23dBm

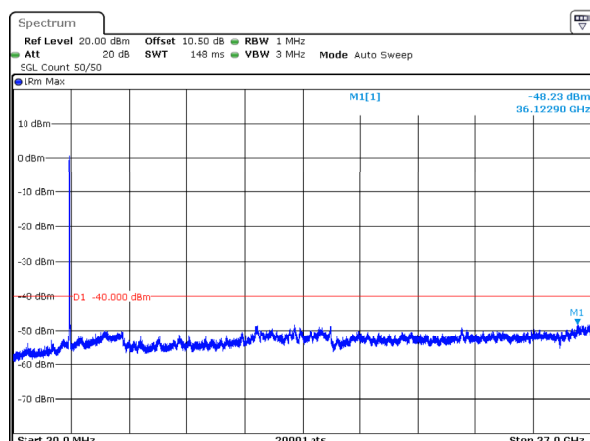


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:32:24

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.93dBm

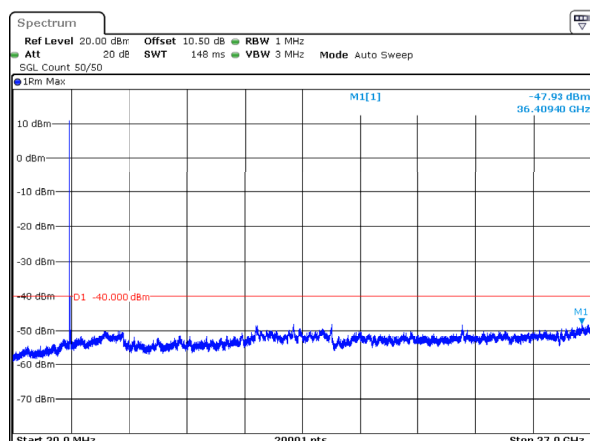


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:29:37

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@132 -48.04dBm

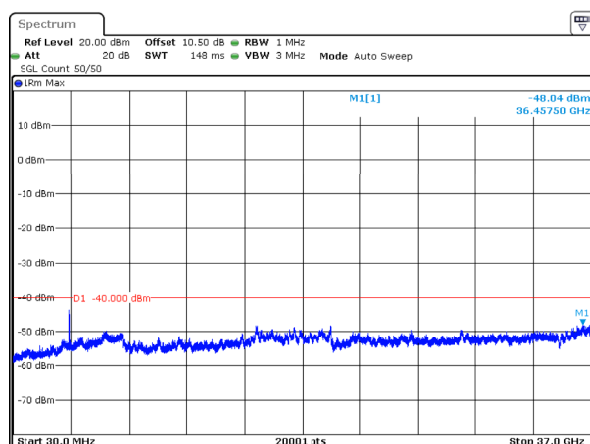


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:31:12

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0 -48.19dBm

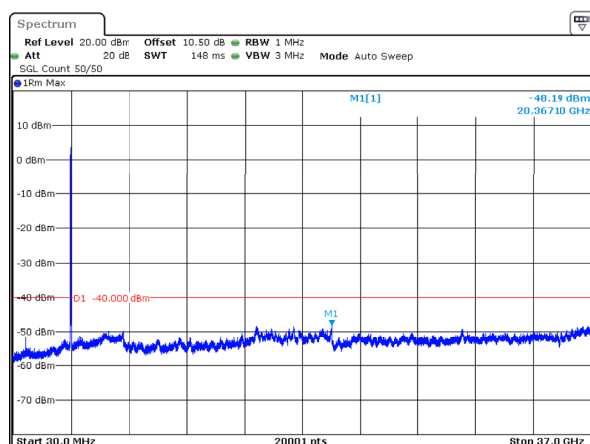


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:36:04

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@0 -47.56dBm

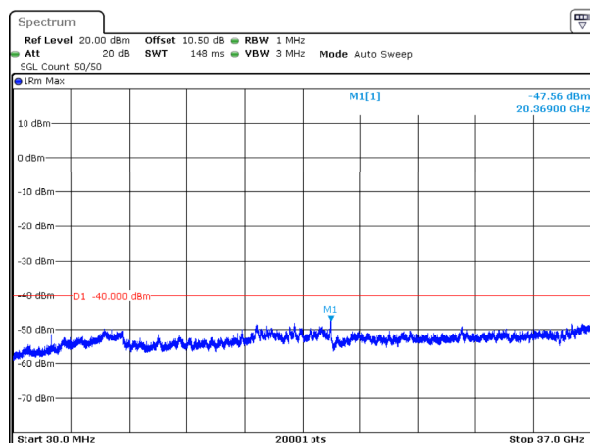


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:33:41

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132 -47.40dBm

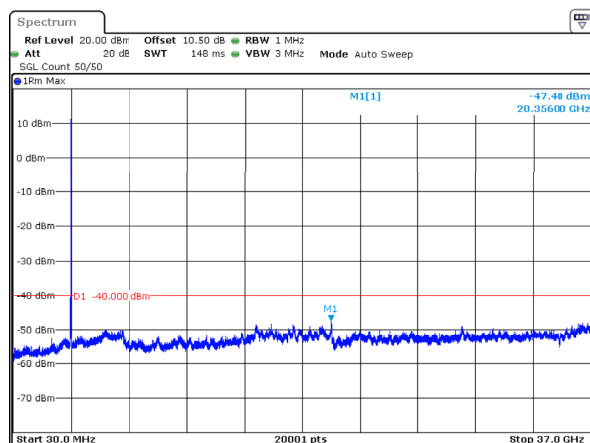


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:34:53

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0 -47.98dBm

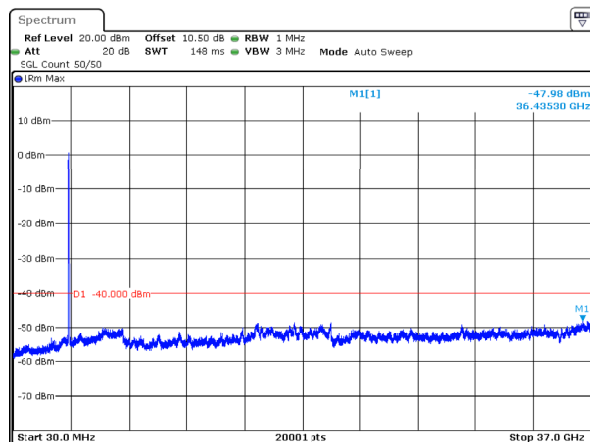


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:39:40

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@0 -47.22dBm

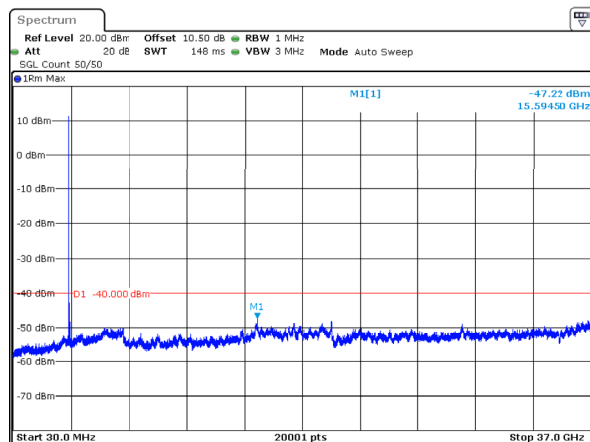


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:37:16

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@161 -47.62dBm

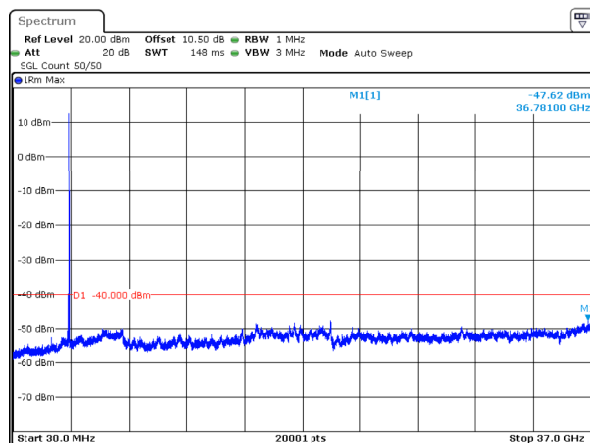


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:38:28

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB162@0 -48.13dBm

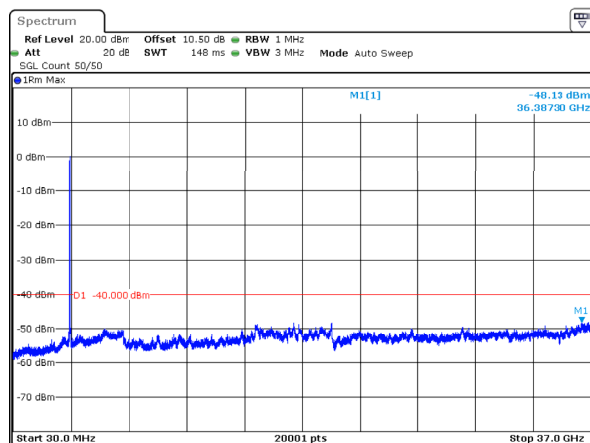


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:43:23

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.70dBm

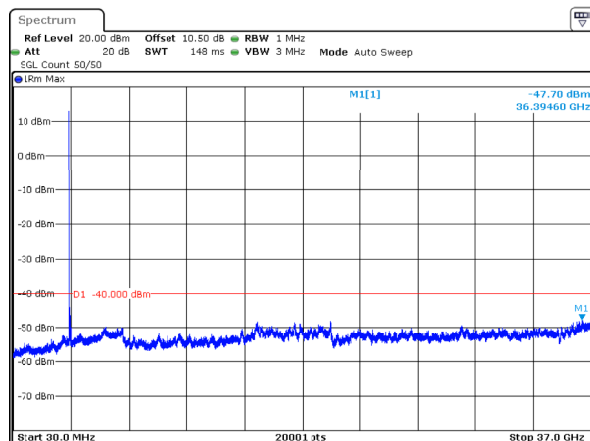


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:40:59

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@161 -47.52dBm

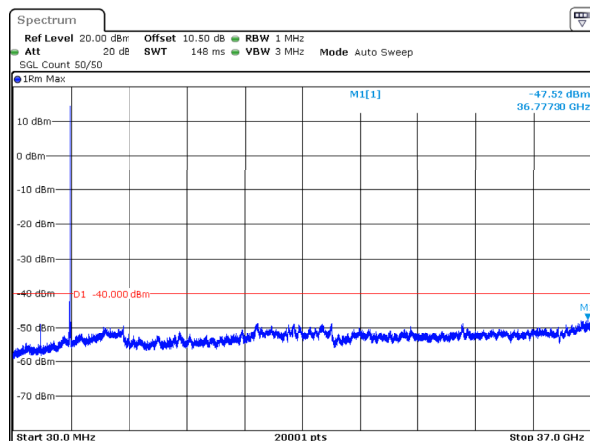


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:42:12

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB162@0 -48.33dBm

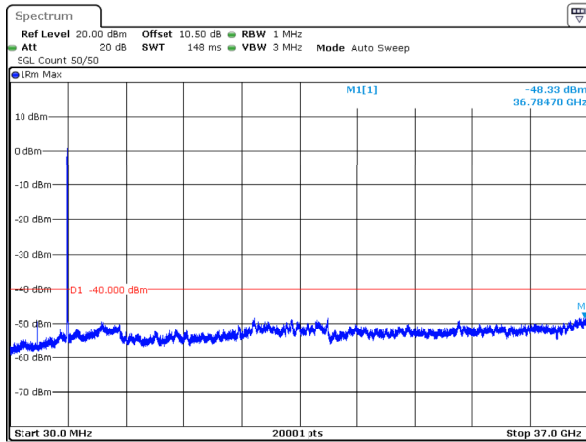


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:47:40

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@0 -47.80dBm

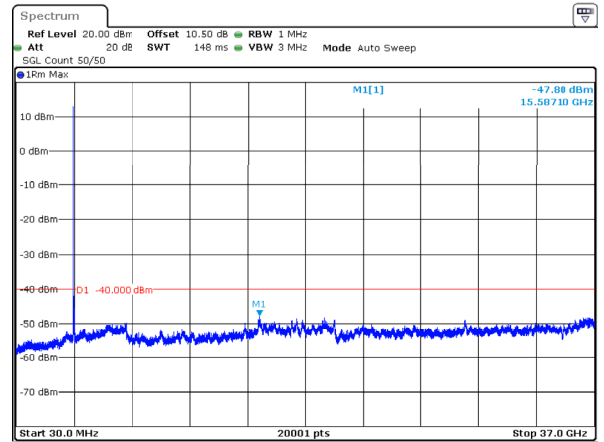


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:45:17

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@161 -48.12dBm

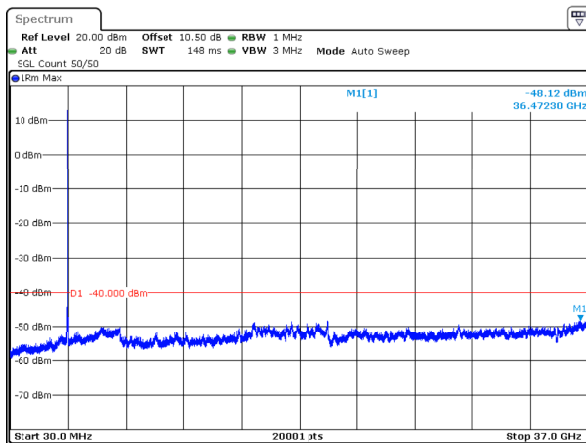


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:46:29

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB180@0 -48.21dBm

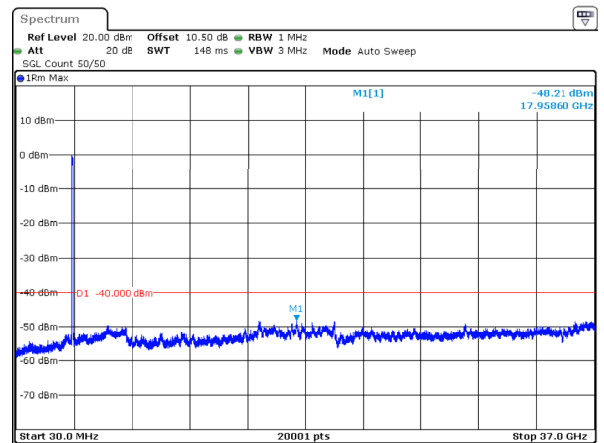


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:51:15

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@0 -46.94dBm

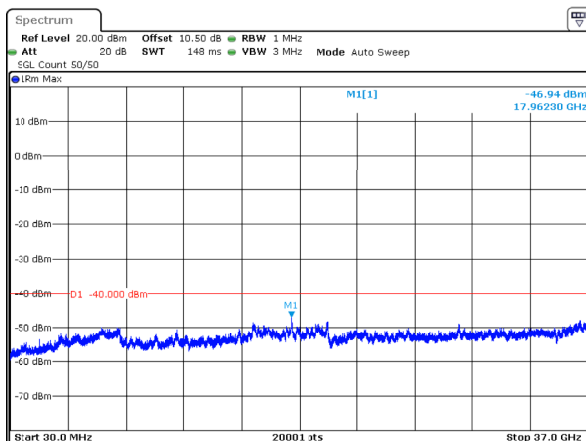

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:48:51

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@188 -47.82dBm

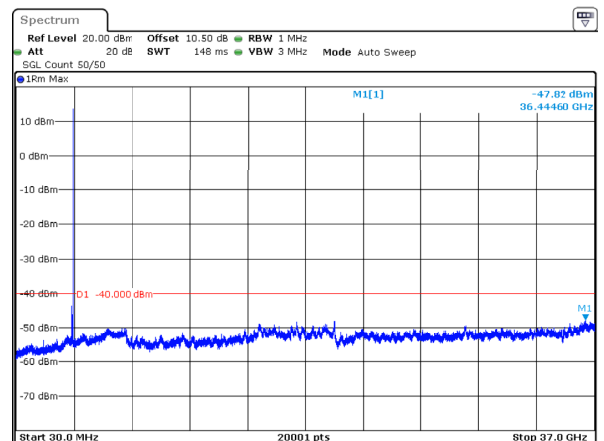

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:50:03