



n41\_10MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -31.65dBm

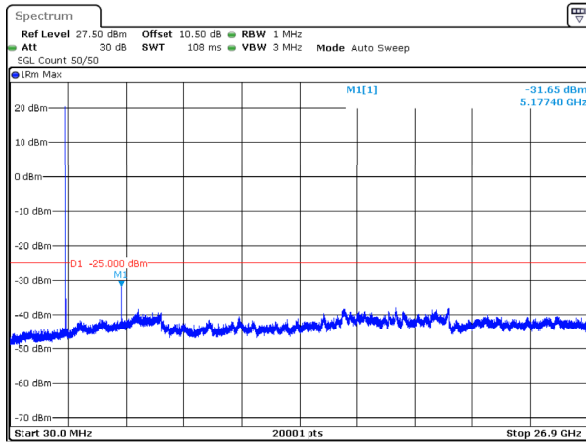


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:20:52

n41\_10MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@23 -36.85dBm

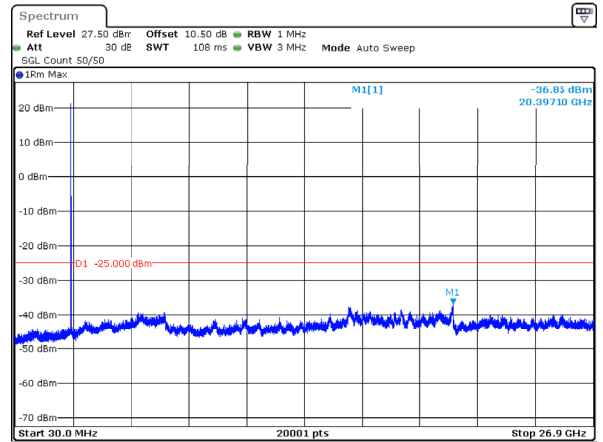


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:21:26

n41\_10MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB24@0 -37.66dBm

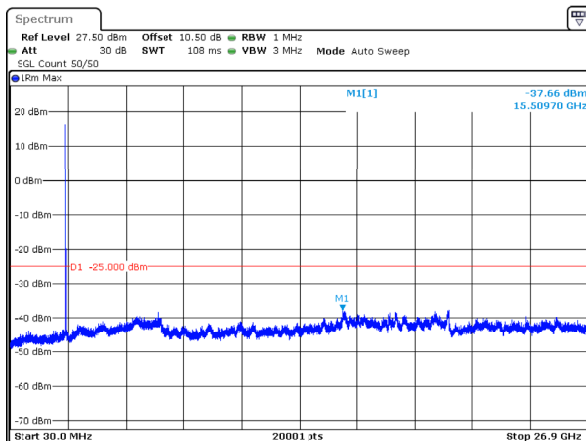


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:22:00

n41\_10MHz\_30kHz\_2685MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.16dBm

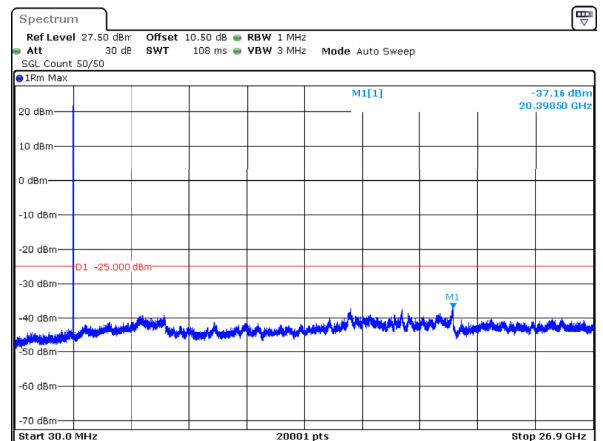


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:23:13

n41\_10MHz\_30kHz\_2685MHz\_DFT-s-OFDM  
QPSK\_RB1@23 -37.17dBm

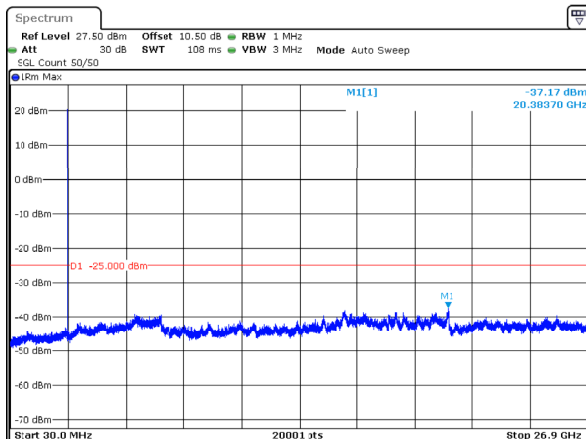


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:23:47

n41\_10MHz\_30kHz\_2685MHz\_DFT-s-OFDM  
QPSK\_RB24@0 -36.34dBm

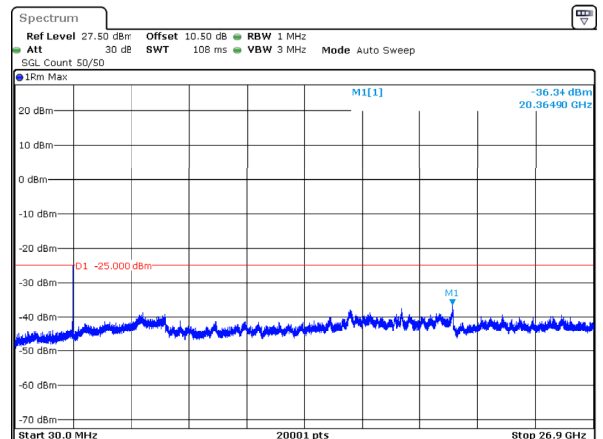


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:24:21

n41\_15MHz\_30kHz\_2503.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.46dBm

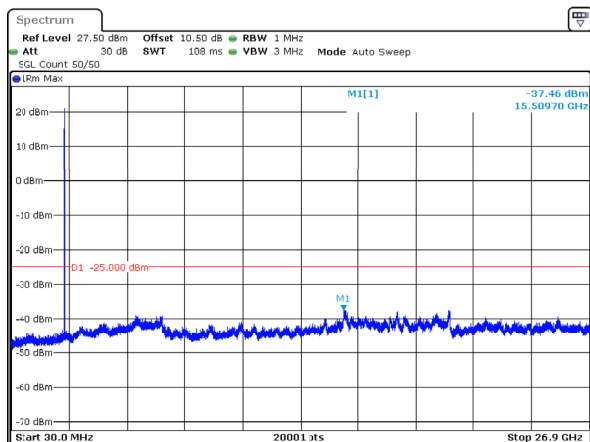


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:25:34

n41\_15MHz\_30kHz\_2503.5MHz\_DFT-s-OFDM  
QPSK\_RB1@37 -37.23dBm

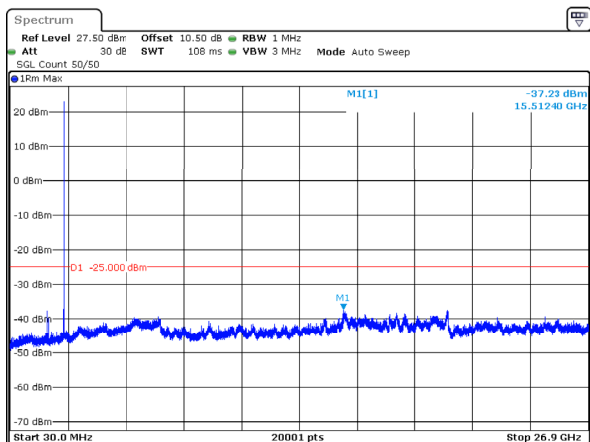


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:26:08

n41\_15MHz\_30kHz\_2503.5MHz\_DFT-s-OFDM  
QPSK\_RB36@0 -37.55dBm

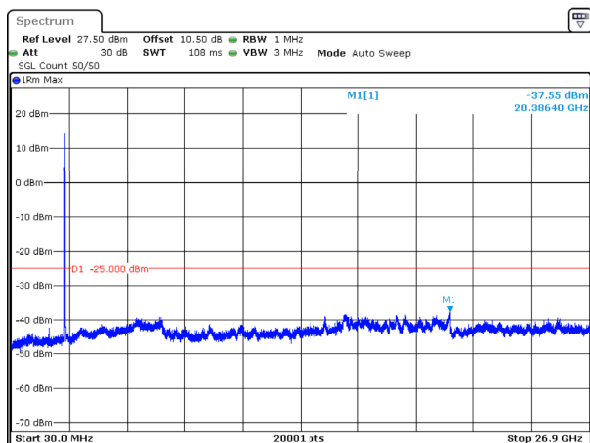


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:26:42

n41\_15MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -31.17dBm

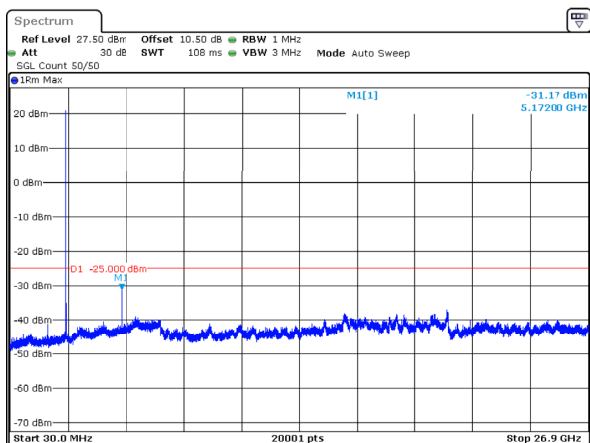


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:27:55

n41\_15MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@37 -37.28dBm

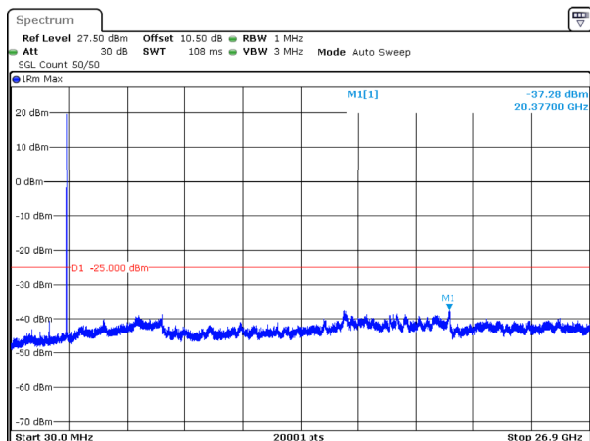


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:28:29

n41\_15MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB36@0 -37.55dBm

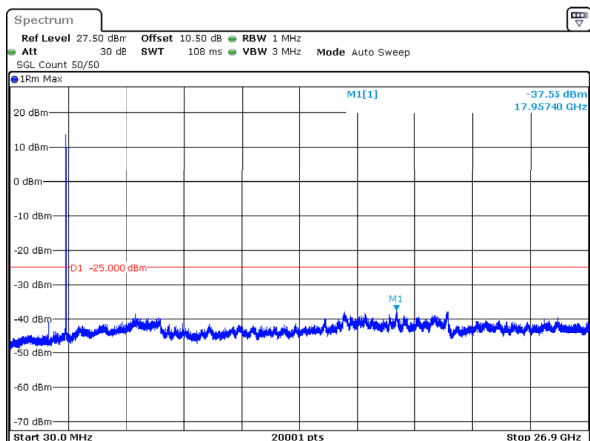


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:29:03

n41\_15MHz\_30kHz\_2682.48MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.05dBm

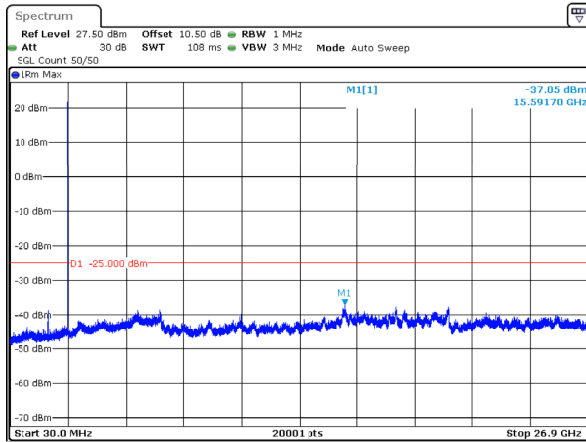


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:30:15

n41\_15MHz\_30kHz\_2682.48MHz\_DFT-s-OFDM  
QPSK\_RB1@37 -36.86dBm

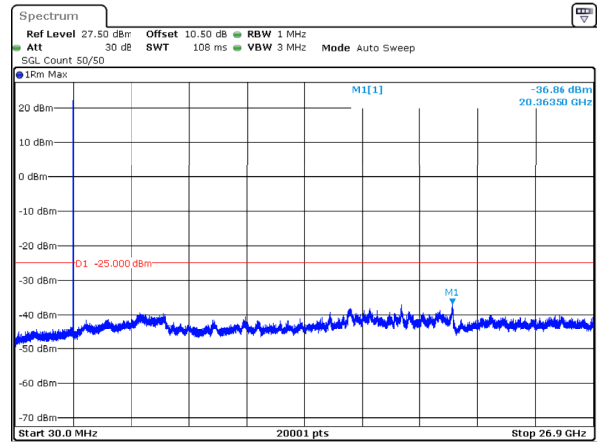


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:30:50

n41\_15MHz\_30kHz\_2682.48MHz\_DFT-s-OFDM  
QPSK\_RB36@0 -36.74dBm

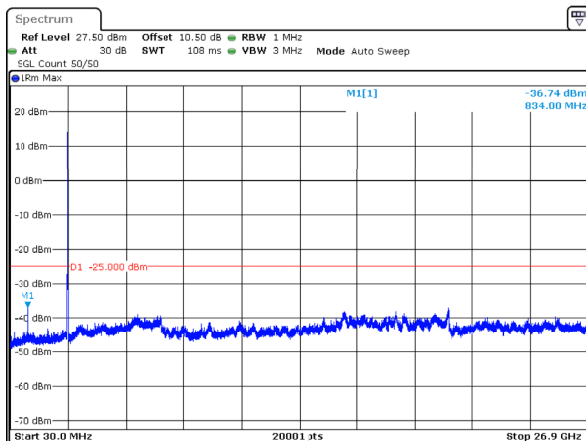


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:31:24

n41\_20MHz\_30kHz\_2506.02MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.22dBm

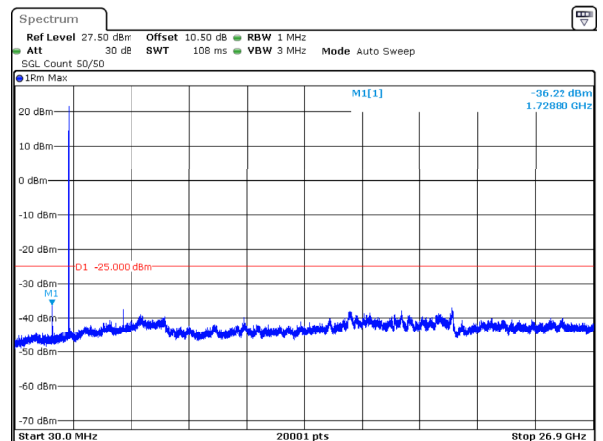


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:32:38

n41\_20MHz\_30kHz\_2506.02MHz\_DFT-s-OFDM  
QPSK\_RB1@50 -36.57dBm

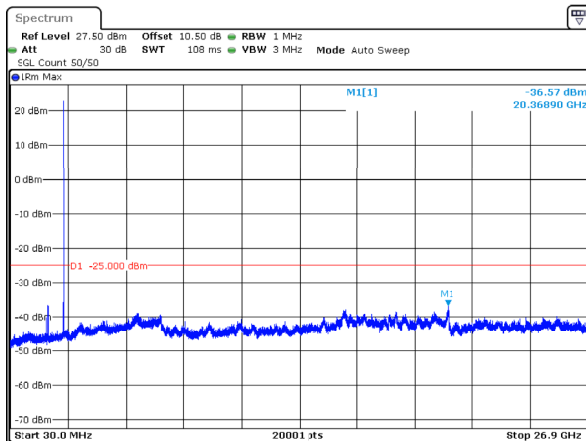


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:33:12

n41\_20MHz\_30kHz\_2506.02MHz\_DFT-s-OFDM  
QPSK\_RB50@0 -37.60dBm

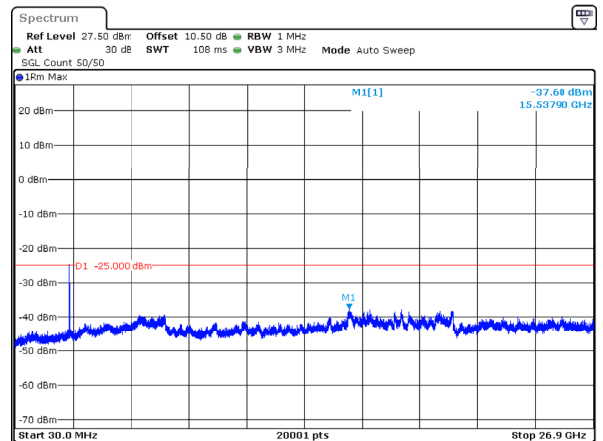


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:33:47

n41\_20MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.45dBm

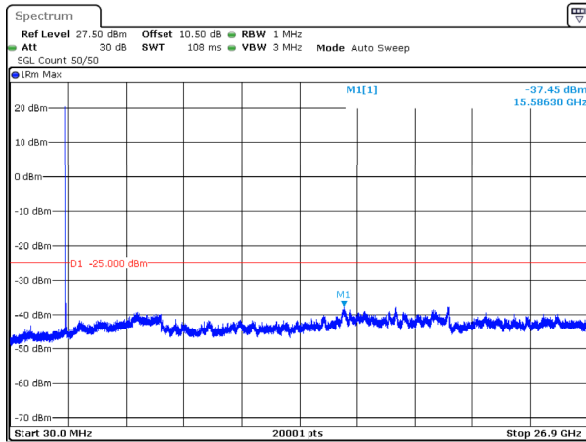


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:35:11

n41\_20MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@50 -37.14dBm

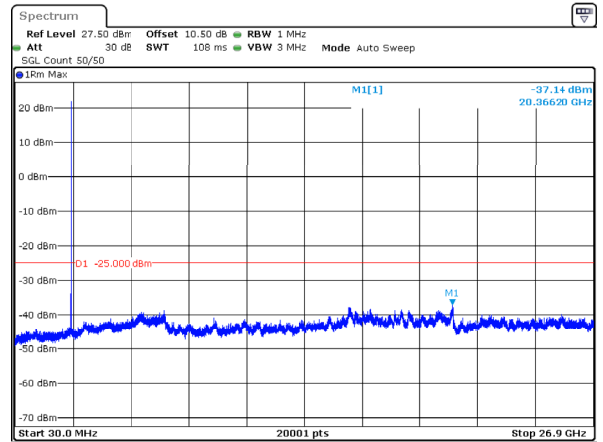


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:35:46

n41\_20MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB50@0 -37.13dBm

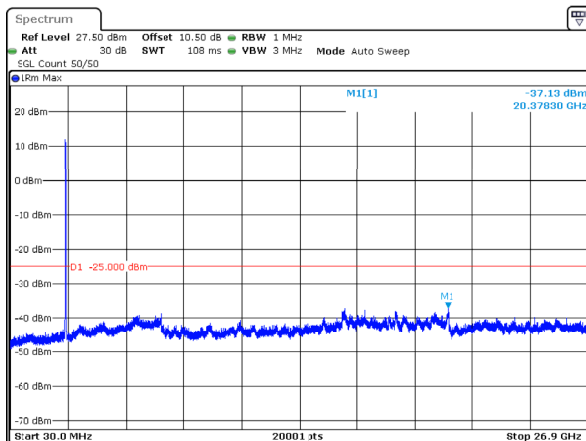


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:36:21

n41\_20MHz\_30kHz\_2679.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.70dBm

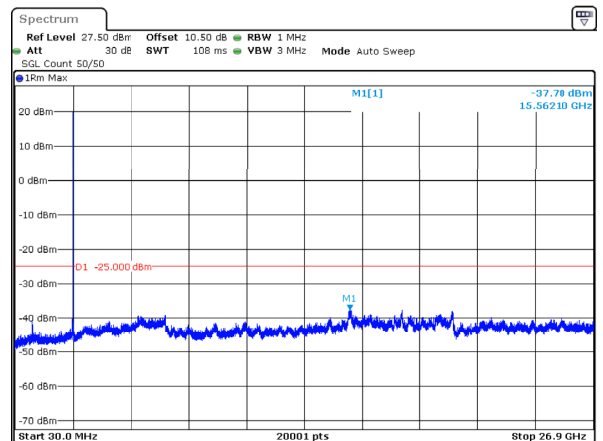


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:37:41

n41\_20MHz\_30kHz\_2679.99MHz\_DFT-s-OFDM  
QPSK\_RB1@50 -37.32dBm

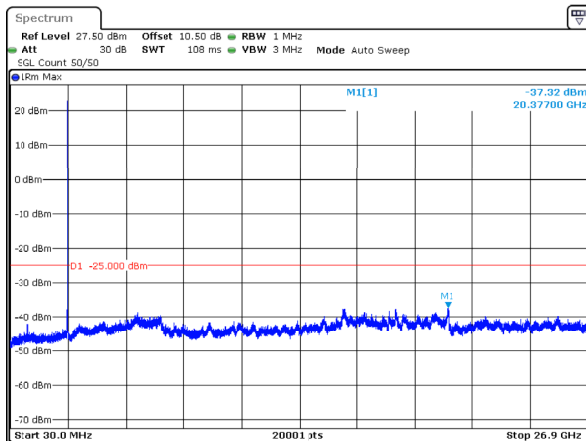


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:38:16

n41\_20MHz\_30kHz\_2679.99MHz\_DFT-s-OFDM  
QPSK\_RB50@0 -37.66dBm

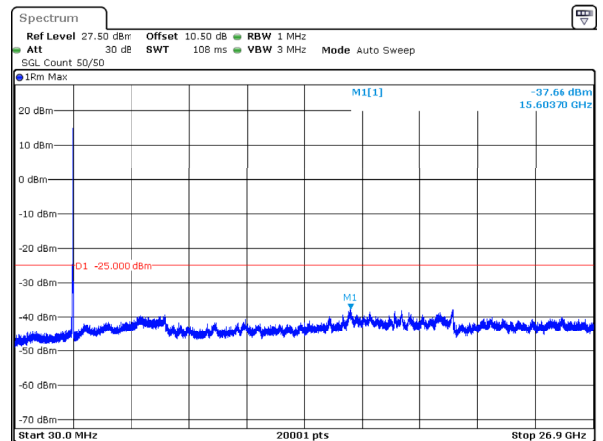


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:38:50

n41\_30MHz\_30kHz\_2511MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.56dBm

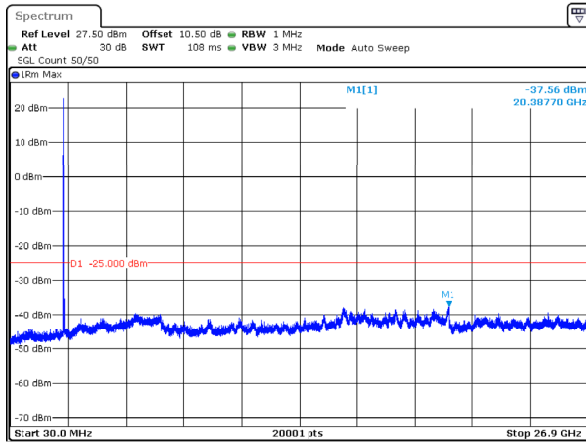


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:40:03

n41\_30MHz\_30kHz\_2511MHz\_DFT-s-OFDM  
QPSK\_RB1@77 -37.87dBm

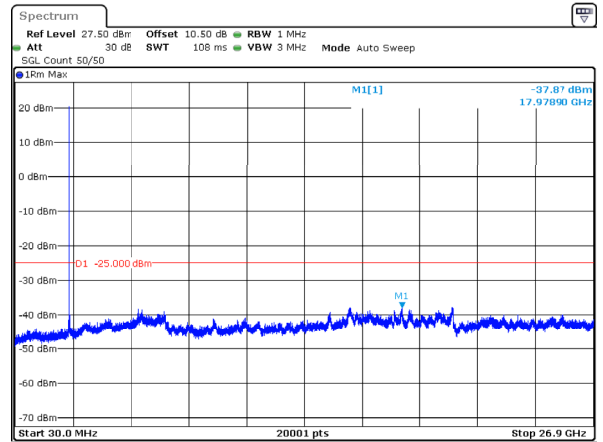


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:40:38

n41\_30MHz\_30kHz\_2511MHz\_DFT-s-OFDM  
QPSK\_RB75@0 -37.46dBm

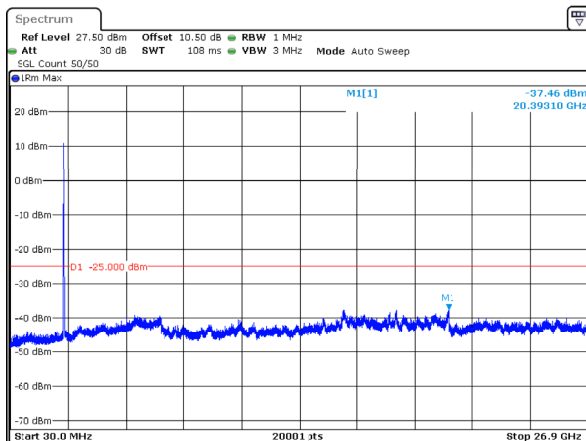


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:41:13

n41\_30MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.26dBm

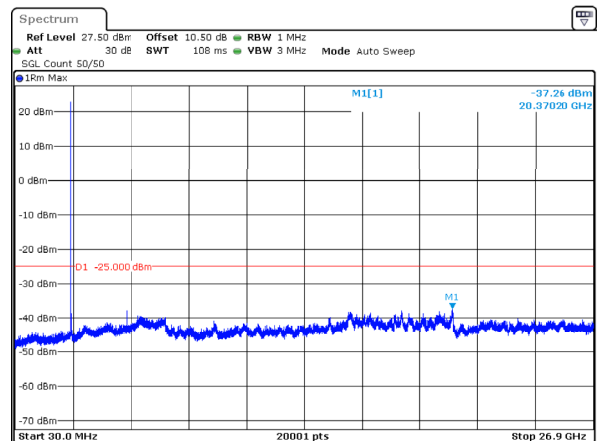


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:42:25

n41\_30MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@77 -36.90dBm

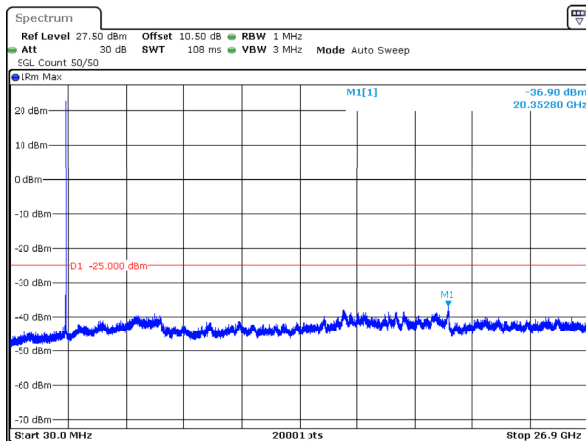


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:43:00

n41\_30MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB75@0 -37.75dBm

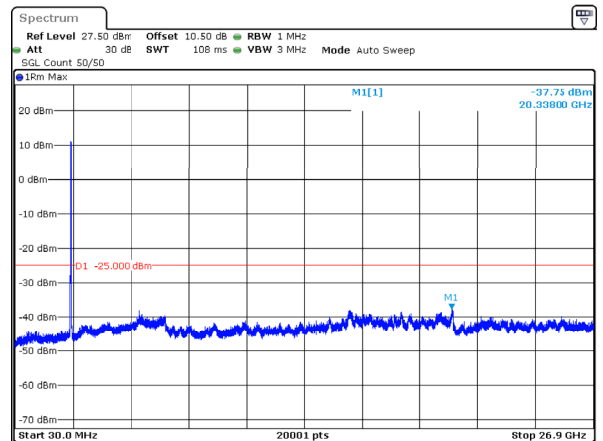


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:43:34

n41\_30MHz\_30kHz\_2674.98MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.66dBm

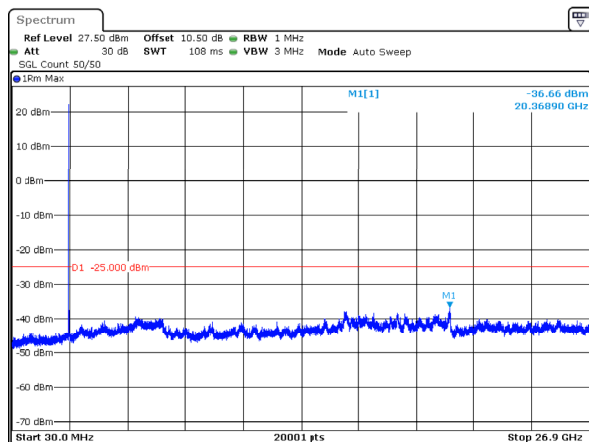


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:44:46

n41\_30MHz\_30kHz\_2674.98MHz\_DFT-s-OFDM  
QPSK\_RB1@77 -37.51dBm

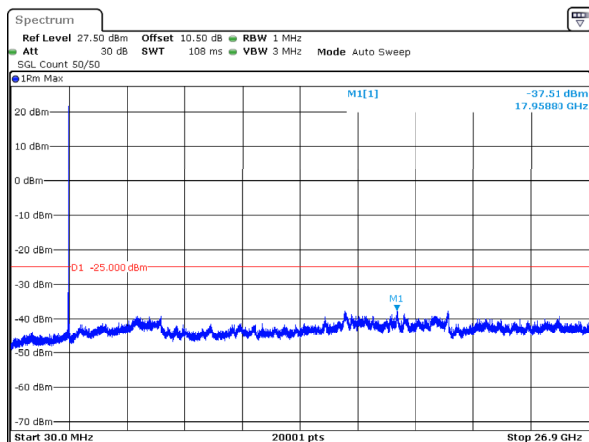


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:45:21

n41\_30MHz\_30kHz\_2674.98MHz\_DFT-s-OFDM  
QPSK\_RB75@0 -37.57dBm

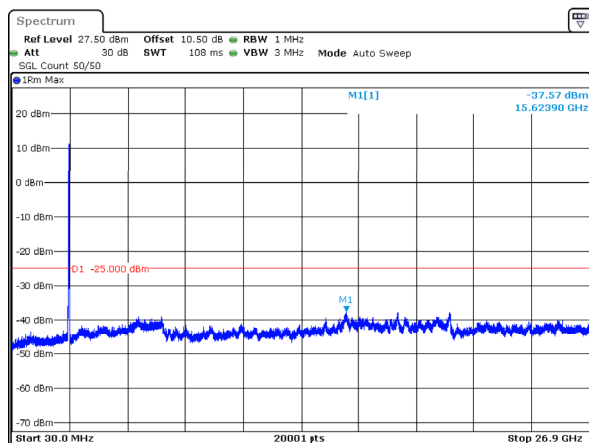


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:45:55

n41\_40MHz\_30kHz\_2516.01MHz\_DFT-s-OFDM  
QPSK\_RB100@0 -37.33dBm

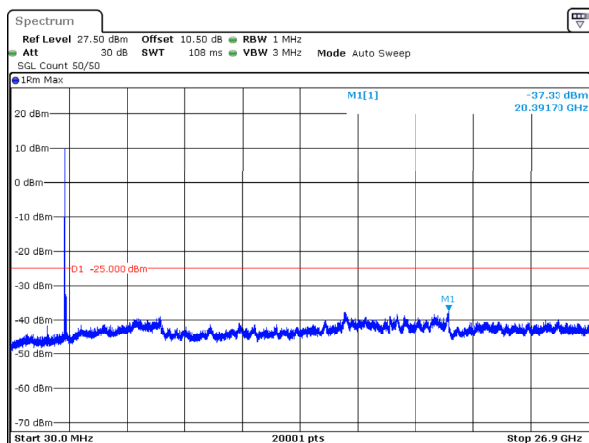


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:48:03

n41\_40MHz\_30kHz\_2516.01MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.57dBm

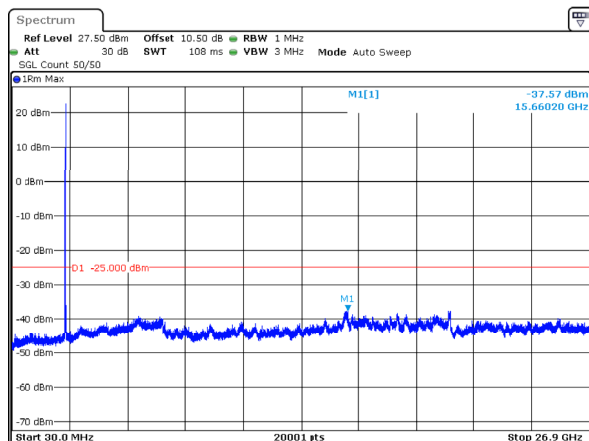


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:46:53

n41\_40MHz\_30kHz\_2516.01MHz\_DFT-s-OFDM  
QPSK\_RB1@105 -37.44dBm

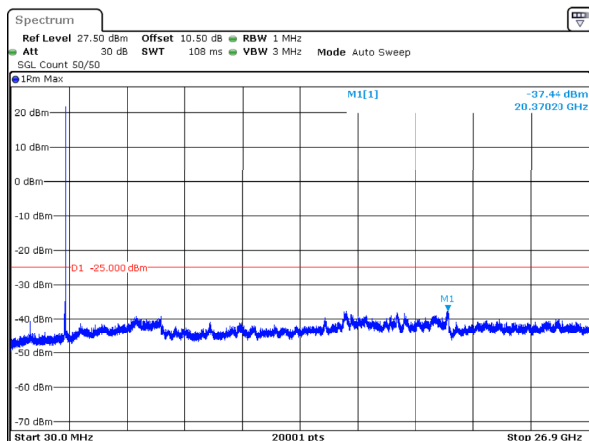


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:47:28

n41\_40MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB100@0 -37.64dBm

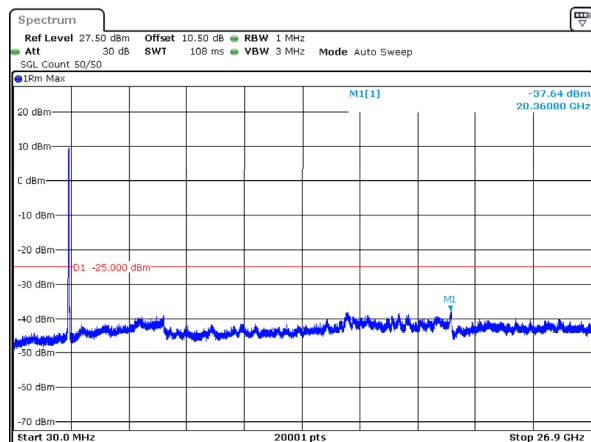


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:50:24

n41\_40MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.26dBm

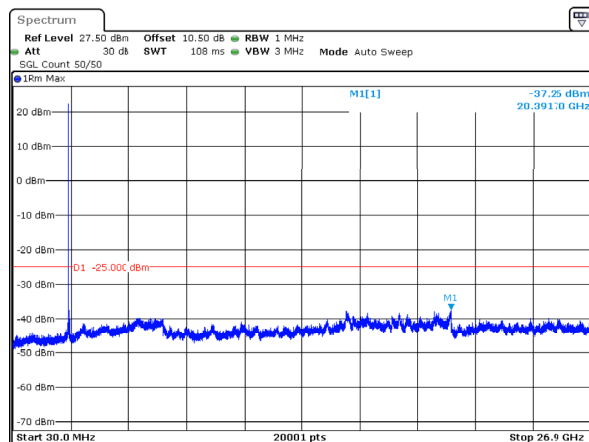


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:49:15

n41\_40MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@105 -37.61dBm

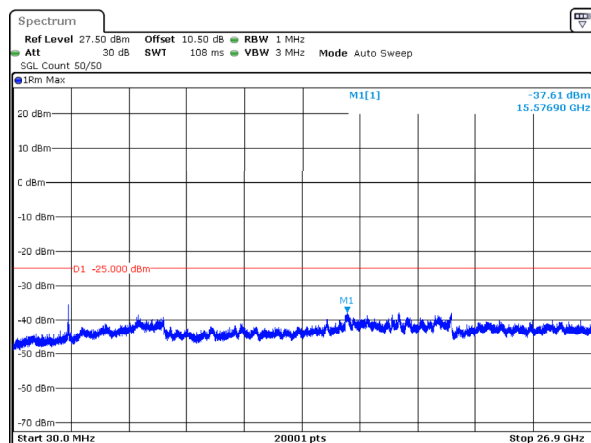


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:49:59

n41\_40MHz\_30kHz\_2670MHz\_DFT-s-OFDM  
QPSK\_RB100@0 -37.48dBm

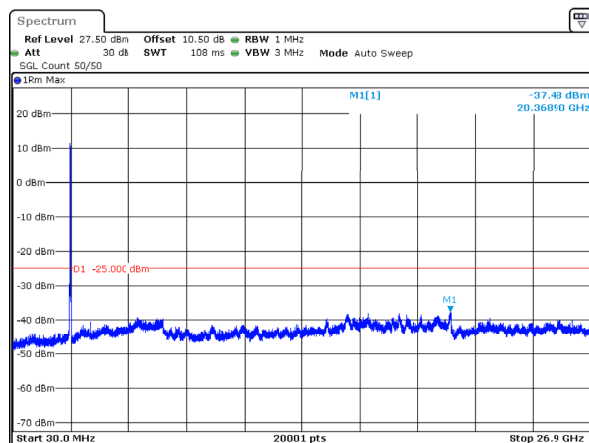


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:52:48

n41\_40MHz\_30kHz\_2670MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.88dBm

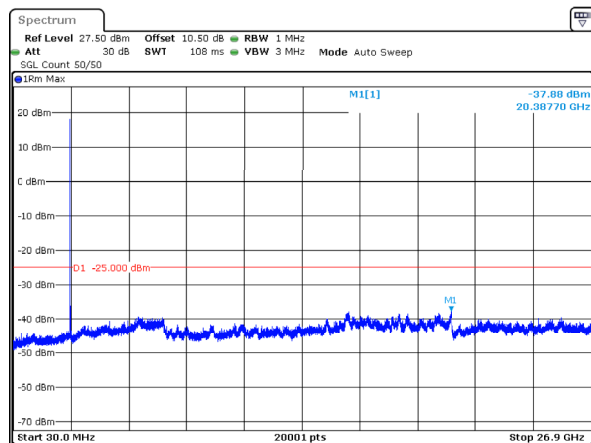


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:51:38

n41\_40MHz\_30kHz\_2670MHz\_DFT-s-OFDM  
QPSK\_RB1@105 -37.10dBm

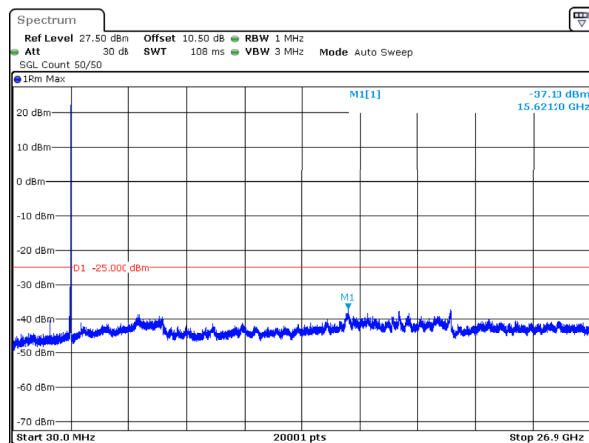


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:52:13

n41\_50MHz\_30kHz\_2521.02MHz\_DFT-s-OFDM  
QPSK\_RB128@0 -36.88dBm

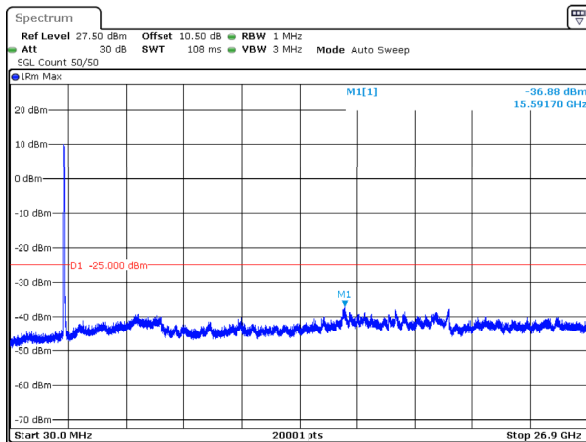


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:54:58

n41\_50MHz\_30kHz\_2521.02MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -34.07dBm

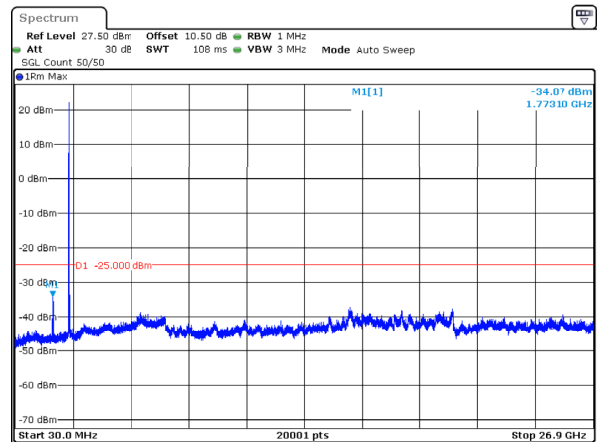


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:53:47

n41\_50MHz\_30kHz\_2521.02MHz\_DFT-s-OFDM  
QPSK\_RB1@132 -37.05dBm

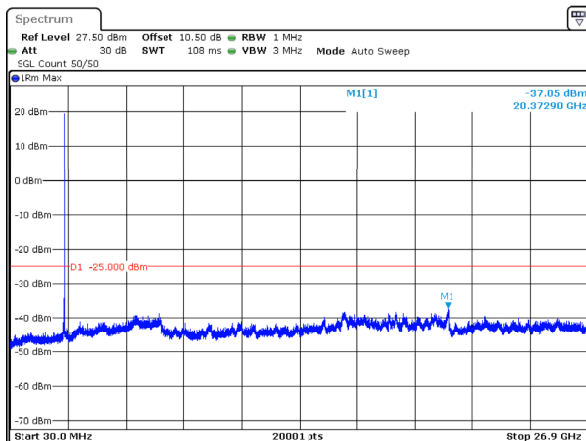


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:54:23

n41\_50MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB128@0 -37.34dBm

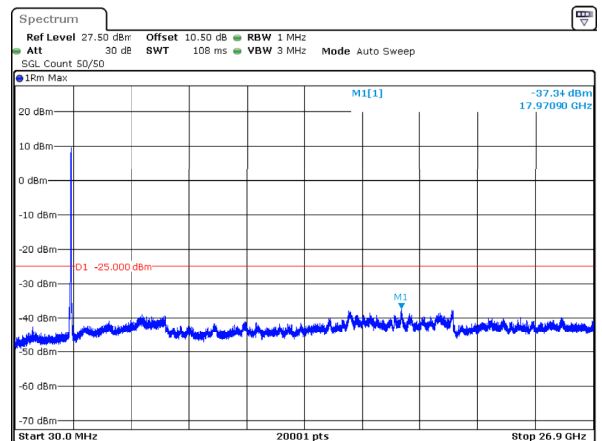


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:58:28

n41\_50MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.08dBm

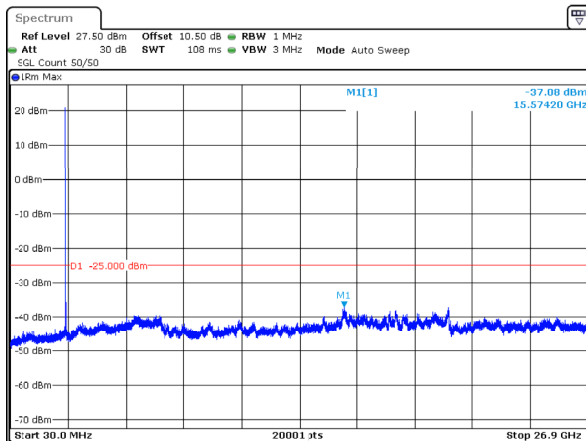


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:57:17

n41\_50MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@132 -37.22dBm

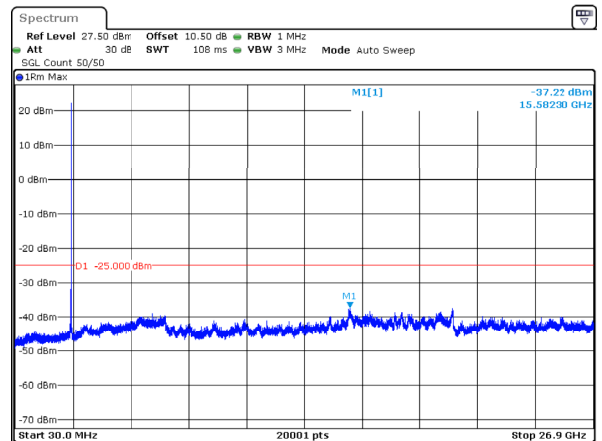


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:57:53

n41\_50MHz\_30kHz\_2664.99MHz\_DFT-s-OFDM  
QPSK\_RB128@0 -37.18dBm

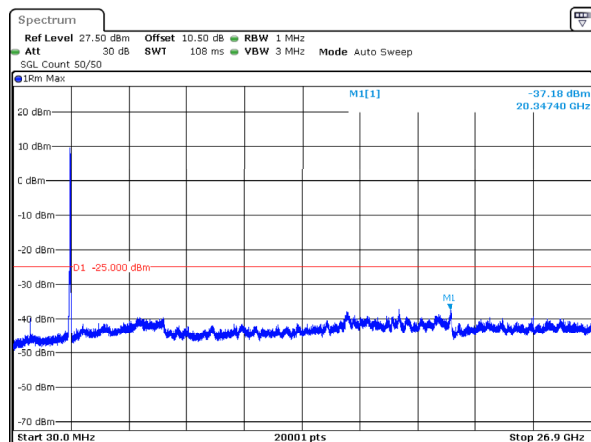


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:01:06

n41\_50MHz\_30kHz\_2664.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.72dBm

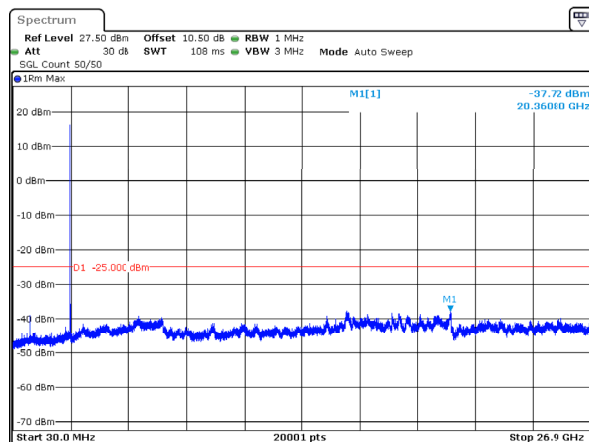


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 10:59:57

n41\_50MHz\_30kHz\_2664.99MHz\_DFT-s-OFDM  
QPSK\_RB1@132 -37.57dBm

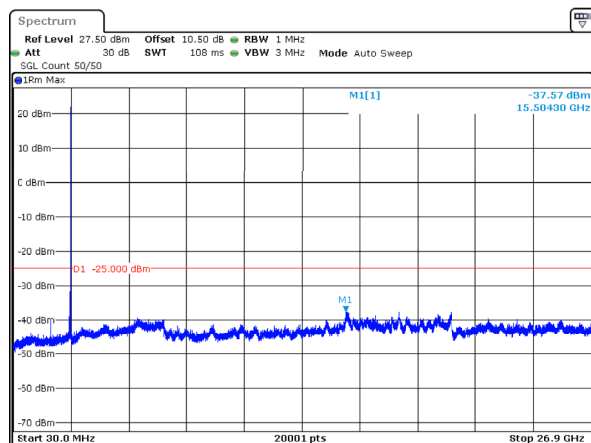


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:00:31

n41\_60MHz\_30kHz\_2526MHz\_DFT-s-OFDM  
QPSK\_RB162@0 -37.45dBm

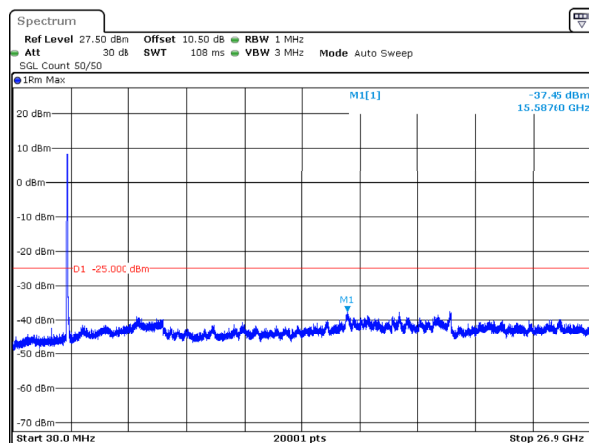


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:03:28

n41\_60MHz\_30kHz\_2526MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.39dBm

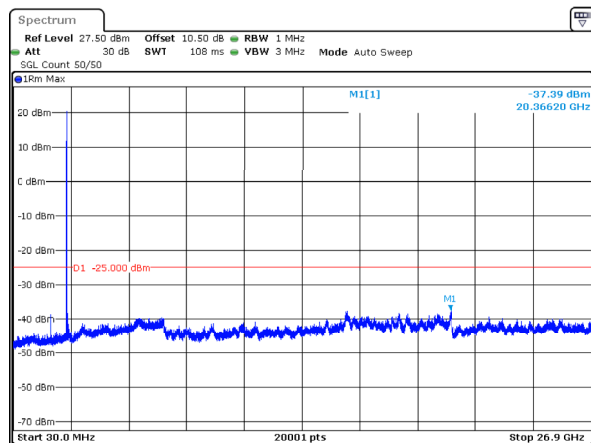


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:02:19

n41\_60MHz\_30kHz\_2526MHz\_DFT-s-OFDM  
QPSK\_RB1@161 -37.23dBm

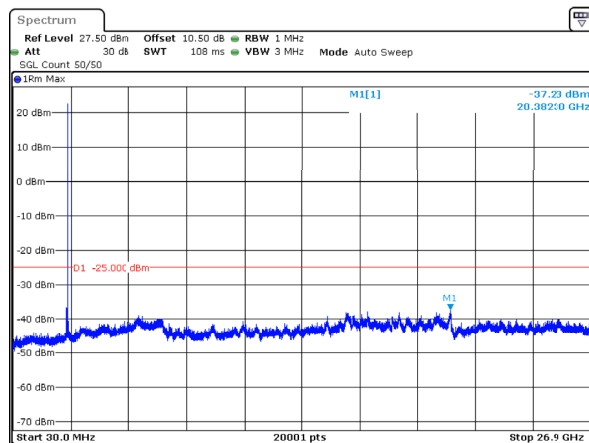


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:02:54

n41\_60MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB162@0 -37.62dBm

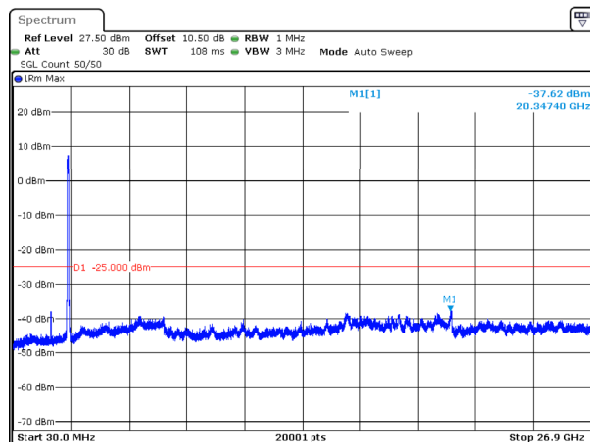


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:05:51

n41\_60MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -35.66dBm

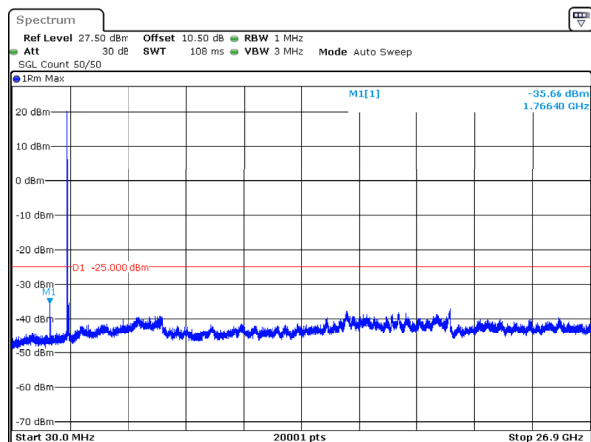


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:04:42

n41\_60MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@161 -37.22dBm

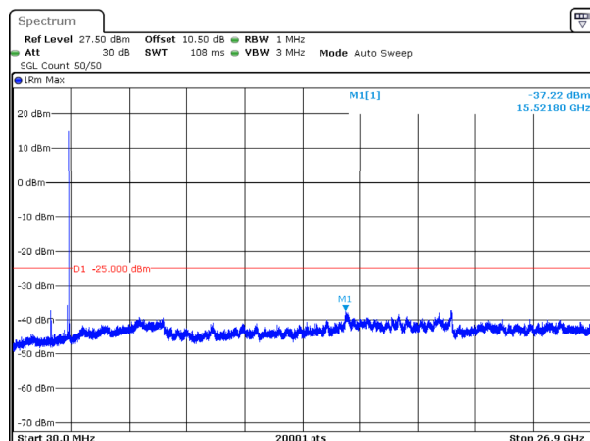


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:05:16

n41\_60MHz\_30kHz\_2659.98MHz\_DFT-s-OFDM  
QPSK\_RB162@0 -37.29dBm

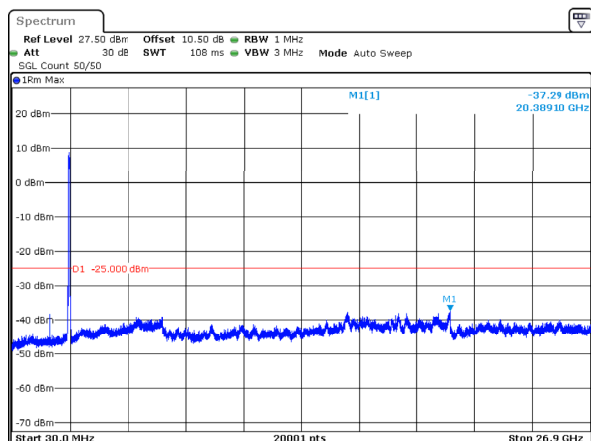


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:08:19

n41\_60MHz\_30kHz\_2659.98MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.80dBm

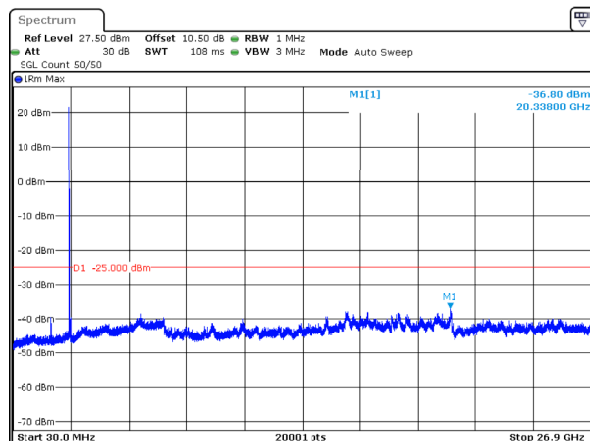


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:07:10

n41\_60MHz\_30kHz\_2659.98MHz\_DFT-s-OFDM  
QPSK\_RB1@161 -35.25dBm

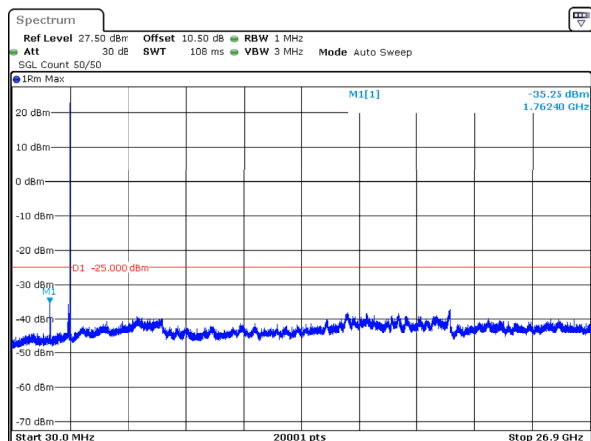


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:07:45

n41\_80MHz\_30kHz\_2536.02MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.43dBm

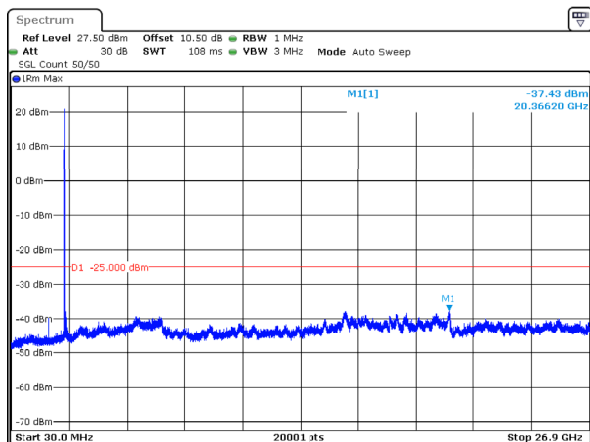


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:09:33

n41\_80MHz\_30kHz\_2536.02MHz\_DFT-s-OFDM  
QPSK\_RB1@216 -36.61dBm

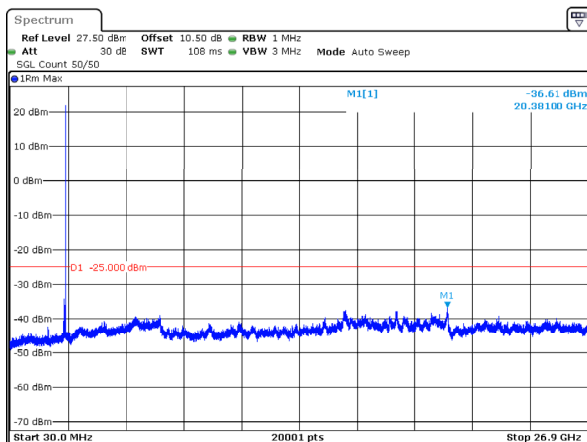


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:10:08

n41\_80MHz\_30kHz\_2536.02MHz\_DFT-s-OFDM  
QPSK\_RB216@0 -37.53dBm

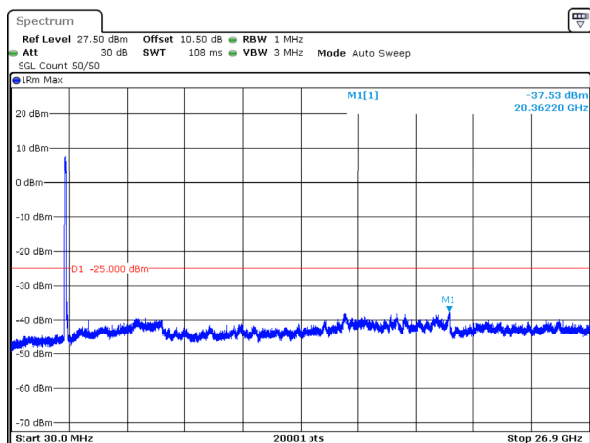


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:10:43

n41\_80MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.64dBm

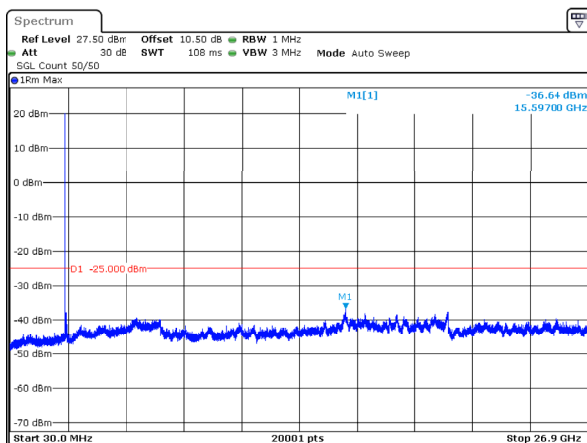


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:12:00

n41\_80MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@216 -36.80dBm

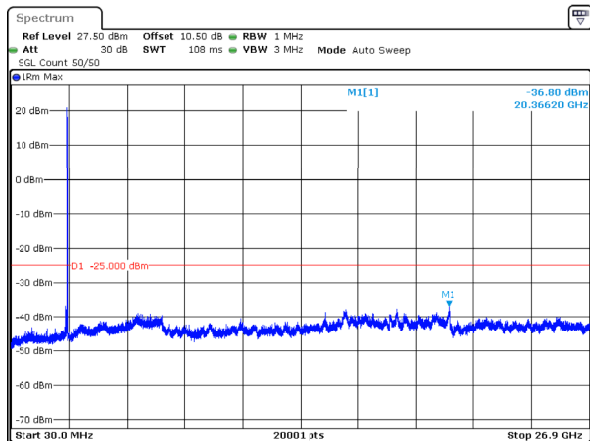


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:12:34

n41\_80MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB216@0 -36.95dBm

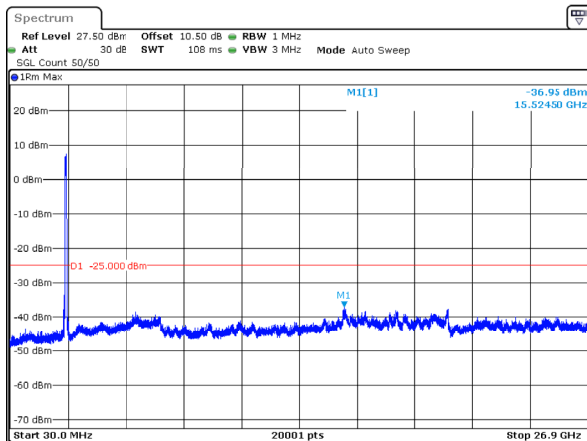


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:13:09

n41\_80MHz\_30kHz\_2649.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -32.91dBm

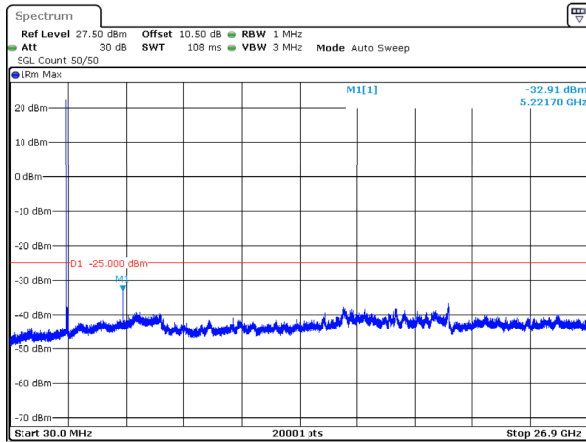


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:14:21

n41\_80MHz\_30kHz\_2649.99MHz\_DFT-s-OFDM  
QPSK\_RB1@216 -30.88dBm

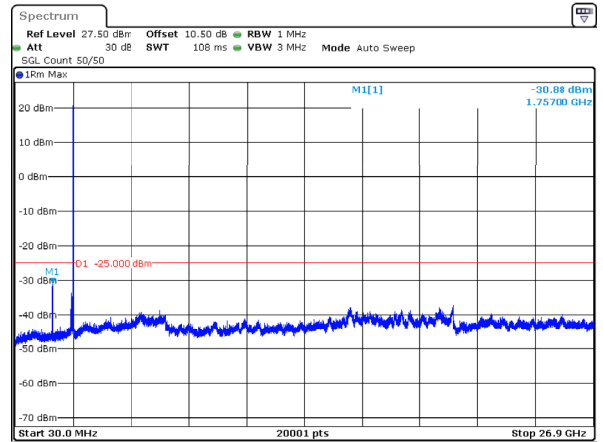


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:14:55

n41\_80MHz\_30kHz\_2649.99MHz\_DFT-s-OFDM  
QPSK\_RB216@0 -37.19dBm

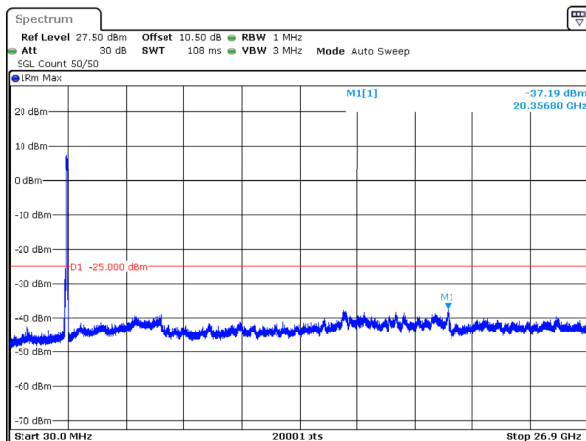


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:15:29

n41\_90MHz\_30kHz\_2541MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.43dBm

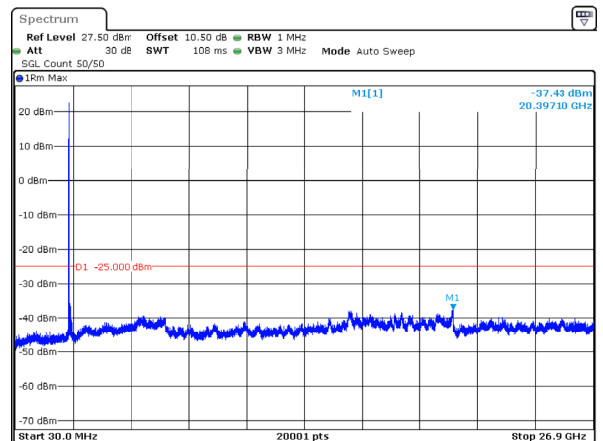


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:16:26

n41\_90MHz\_30kHz\_2541MHz\_DFT-s-OFDM  
QPSK\_RB1@244 -36.27dBm

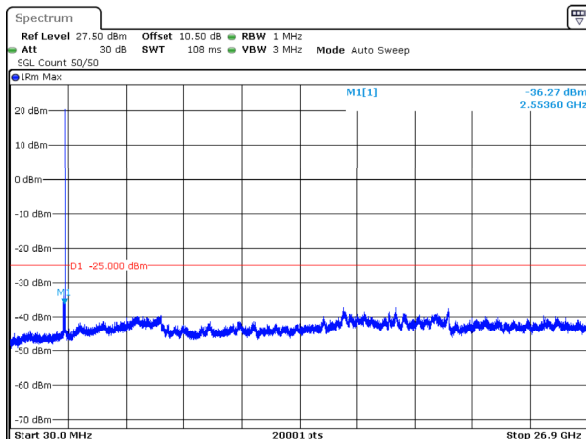


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:17:01

n41\_90MHz\_30kHz\_2541MHz\_DFT-s-OFDM  
QPSK\_RB243@0 -37.17dBm

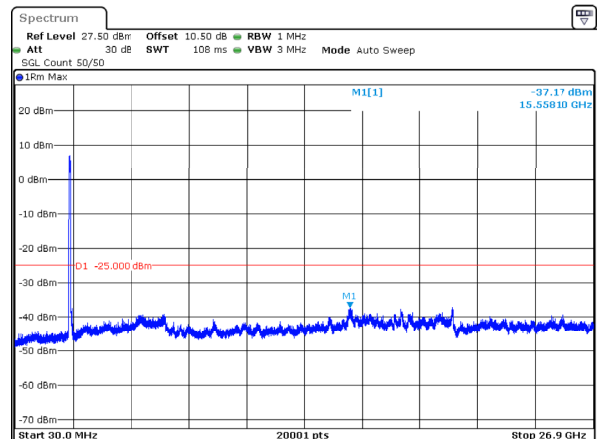


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:17:35

n41\_90MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.71dBm

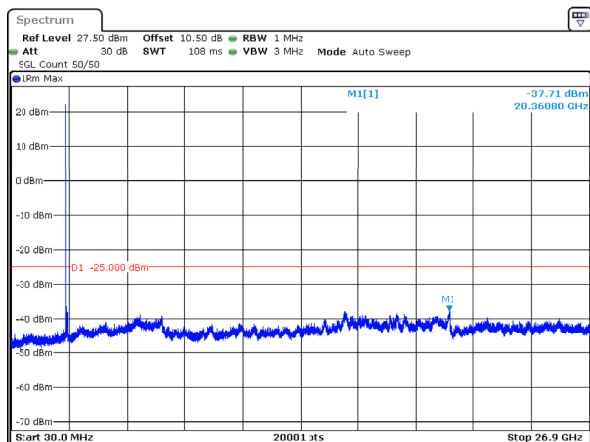


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:18:46

n41\_90MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@244 -37.11dBm

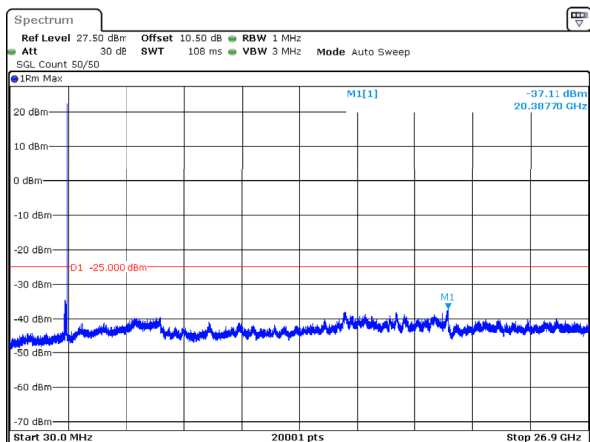


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:19:20

n41\_90MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB243@0 -37.55dBm

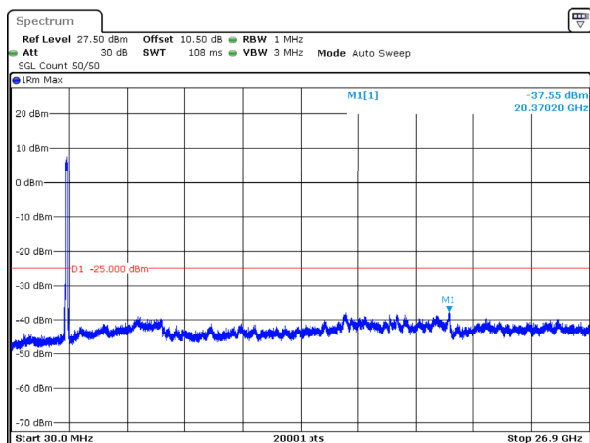


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:19:54

n41\_90MHz\_30kHz\_2644.98MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.75dBm

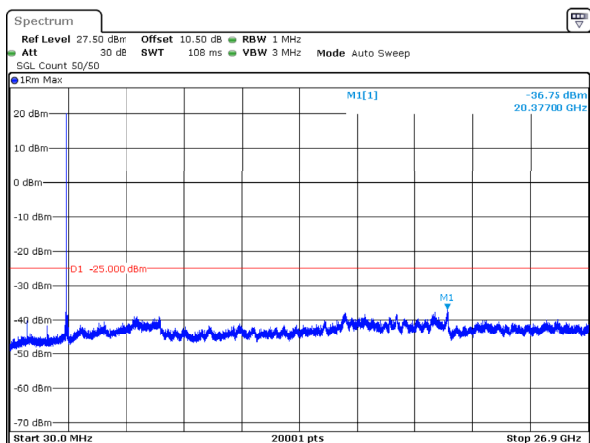


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:20:51

n41\_90MHz\_30kHz\_2644.98MHz\_DFT-s-OFDM  
QPSK\_RB1@244 -36.40dBm

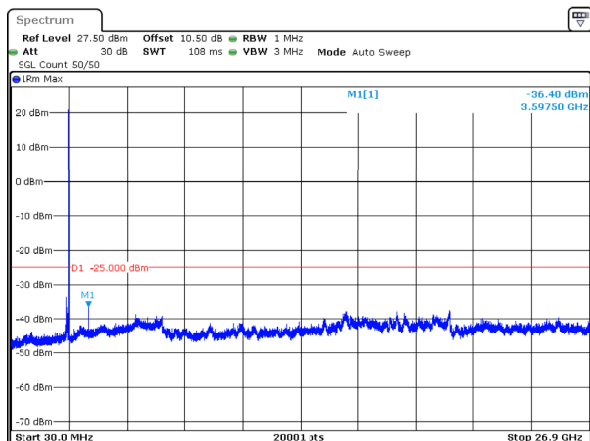


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:21:25

n41\_90MHz\_30kHz\_2644.98MHz\_DFT-s-OFDM  
QPSK\_RB243@0 -37.24dBm

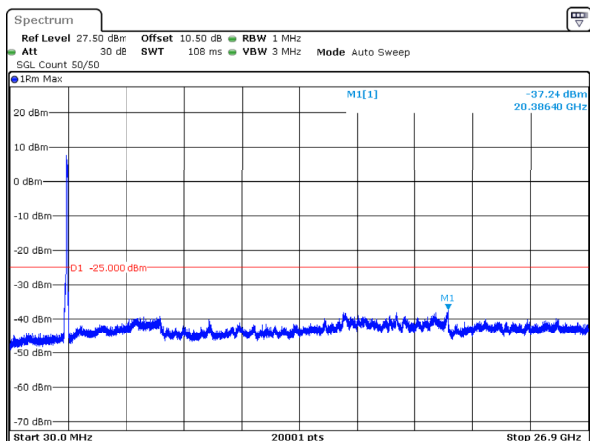


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:21:58

n41\_100MHz\_30kHz\_2546.01MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.12dBm

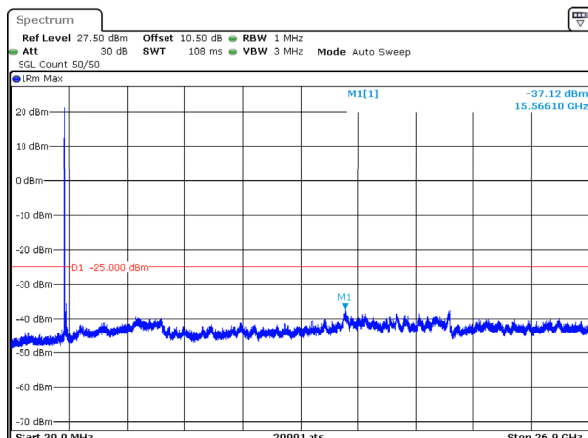


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:23:10

n41\_100MHz\_30kHz\_2546.01MHz\_DFT-s-OFDM  
QPSK\_RB1@272 -36.46dBm

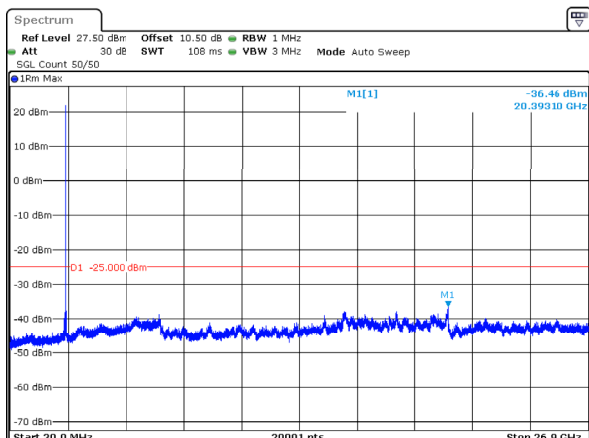


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:23:44

n41\_100MHz\_30kHz\_2546.01MHz\_DFT-s-OFDM  
QPSK\_RB270@0 -37.55dBm

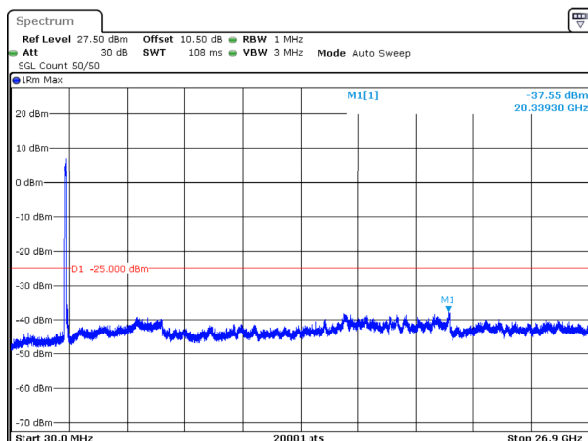


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:24:18

n41\_100MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.35dBm

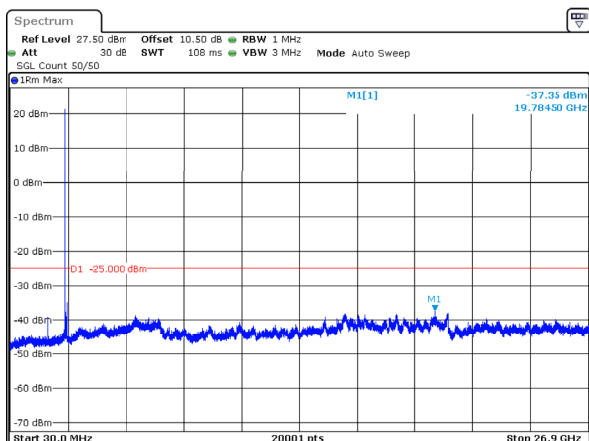


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:25:33

n41\_100MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@272 -37.45dBm

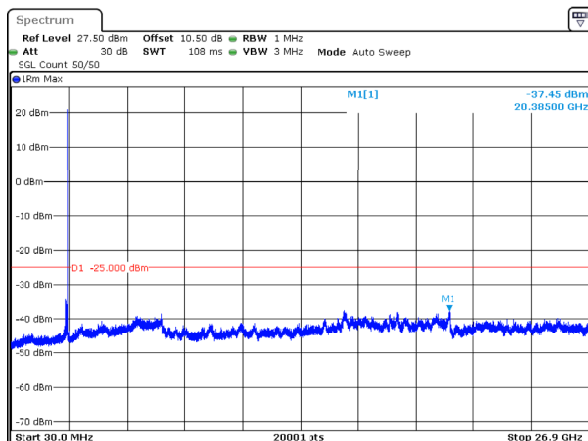


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:26:07

n41\_100MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB270@0 -37.57dBm

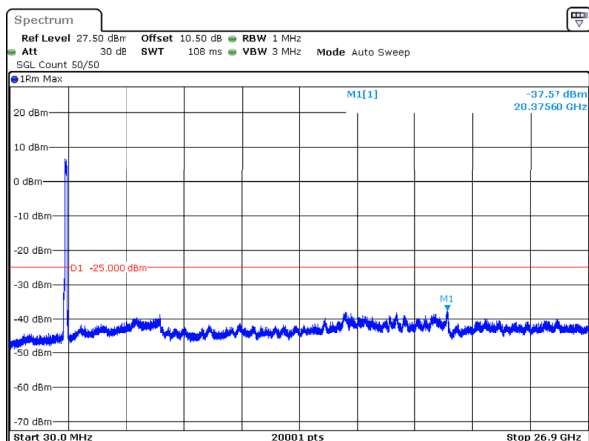


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:26:41

n41\_100MHz\_30kHz\_2640MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -29.38dBm

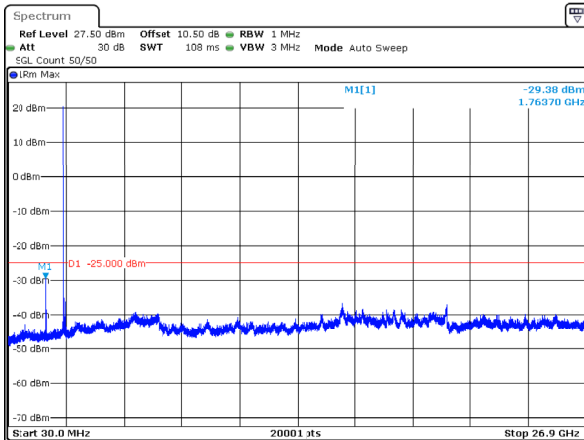

ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:27:39


n41\_100MHz\_30kHz\_2640MHz\_DFT-s-OFDM  
QPSK\_RB1@272 -37.39dBm

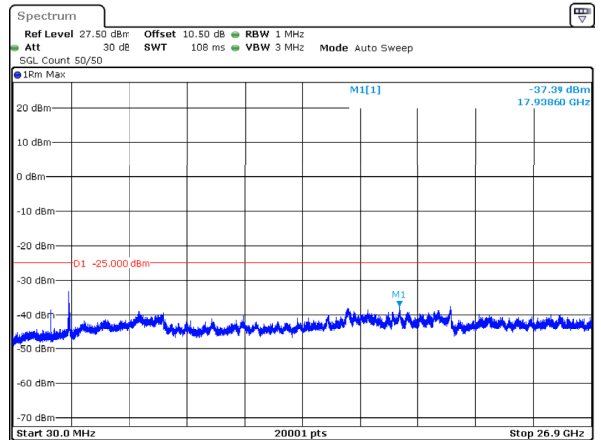

ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:28:13


n66

n41\_100MHz\_30kHz\_2640MHz\_DFT-s-OFDM  
QPSK\_RB270@0 -37.50dBm

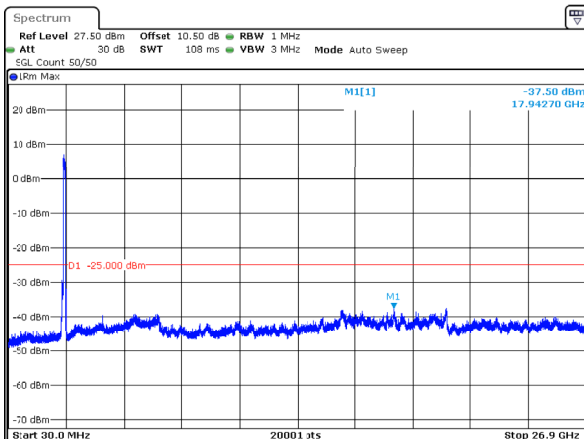


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:28:47

n66\_5MHz\_15kHz\_1712.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.10dBm

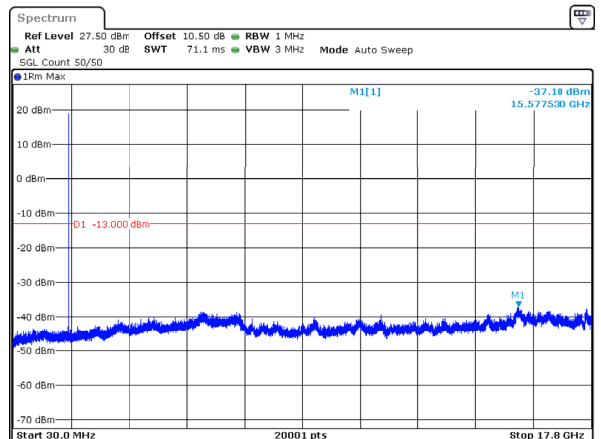


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:29:54

n66\_5MHz\_15kHz\_1712.5MHz\_DFT-s-OFDM  
QPSK\_RB1@24 -36.30dBm

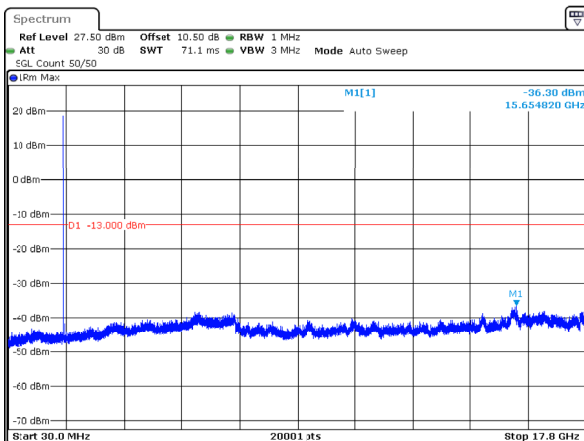


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:30:22

n66\_5MHz\_15kHz\_1712.5MHz\_DFT-s-OFDM  
QPSK\_RB25@0 -36.22dBm

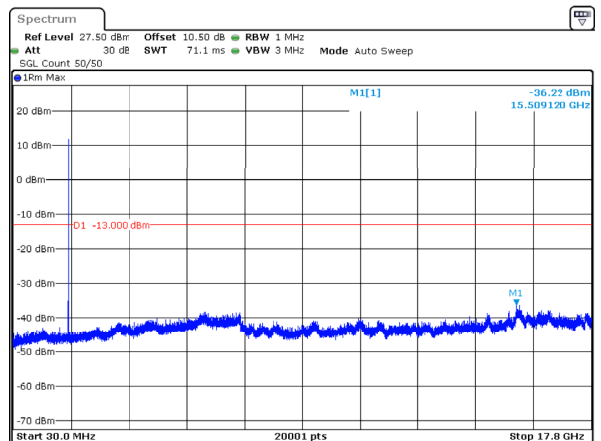


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:30:50

n66\_5MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.93dBm

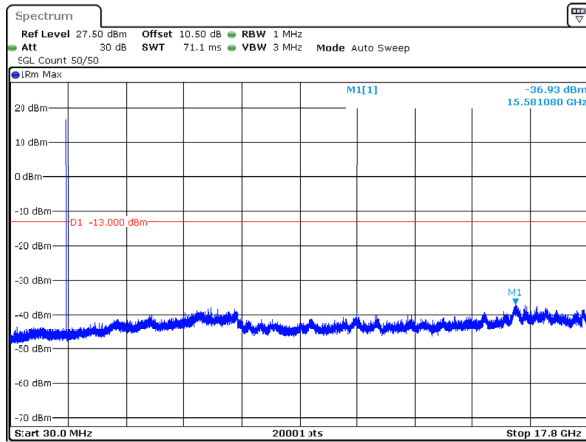


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:33:02

n66\_5MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@24 -36.36dBm

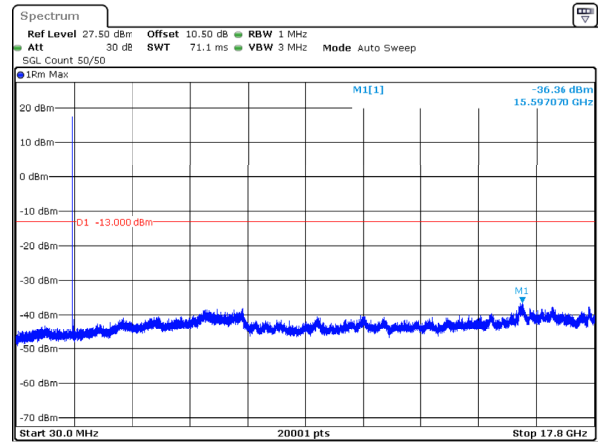


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:33:29

n66\_5MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB25@0 -36.63dBm

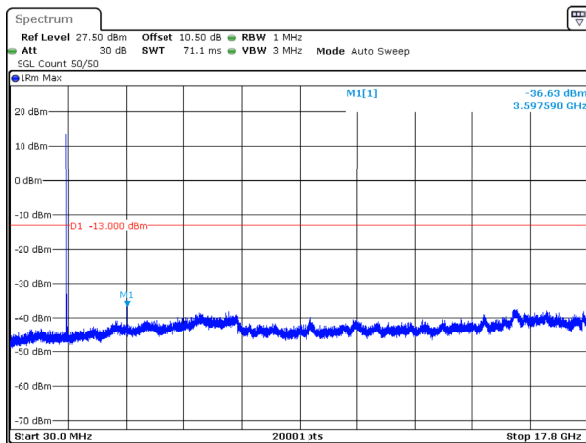


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:33:57

n66\_5MHz\_15kHz\_1777.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.82dBm

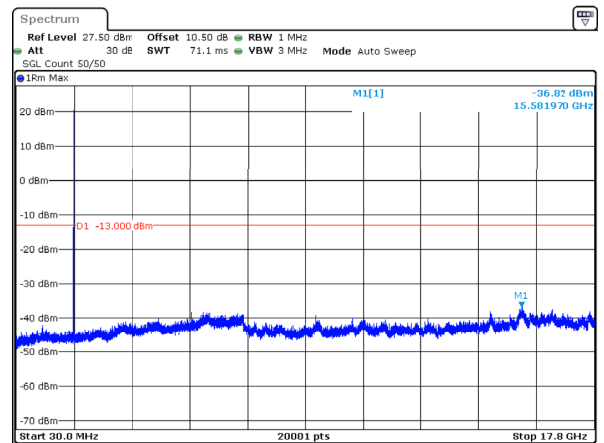


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:35:10

n66\_5MHz\_15kHz\_1777.5MHz\_DFT-s-OFDM  
QPSK\_RB1@24 -36.96dBm

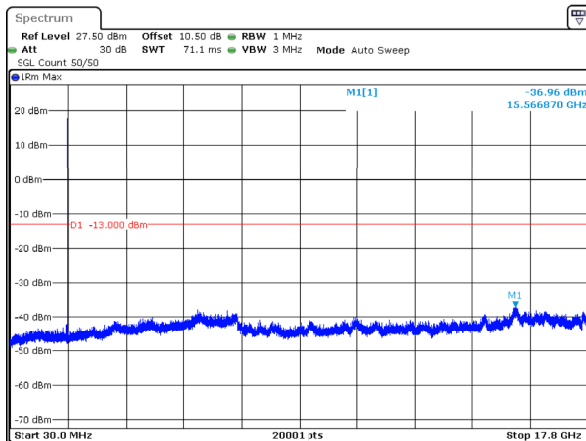


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:35:38

n66\_5MHz\_15kHz\_1777.5MHz\_DFT-s-OFDM  
QPSK\_RB25@0 -36.56dBm

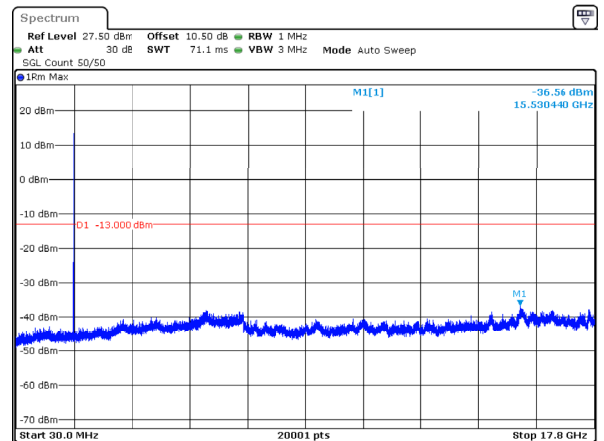


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:36:06

n66\_10MHz\_15kHz\_1715MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.02dBm

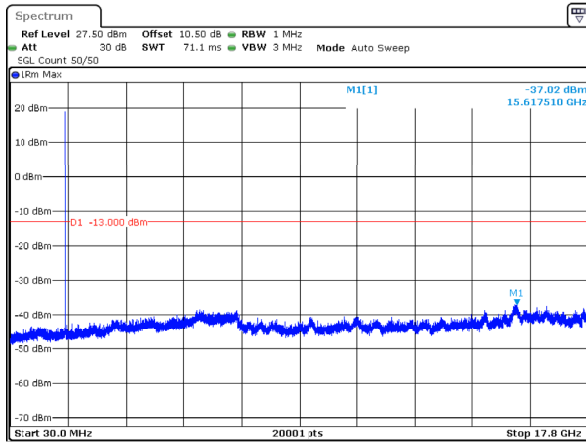


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:37:16

n66\_10MHz\_15kHz\_1715MHz\_DFT-s-OFDM  
QPSK\_RB1@51 -36.02dBm

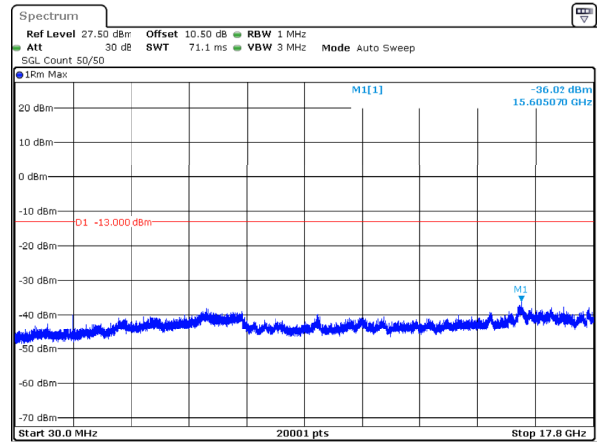


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:37:44

n66\_10MHz\_15kHz\_1715MHz\_DFT-s-OFDM  
QPSK\_RB50@0 -37.21dBm

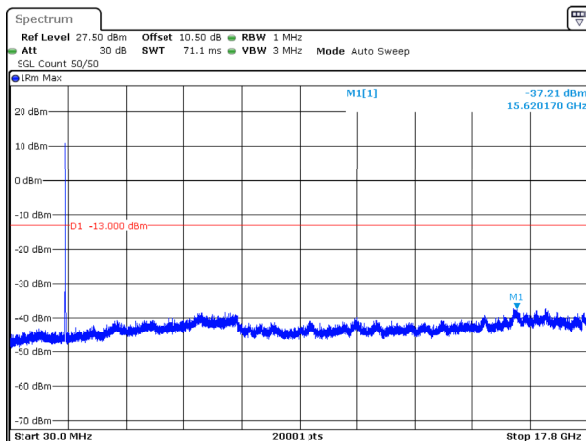


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:38:12

n66\_10MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.13dBm

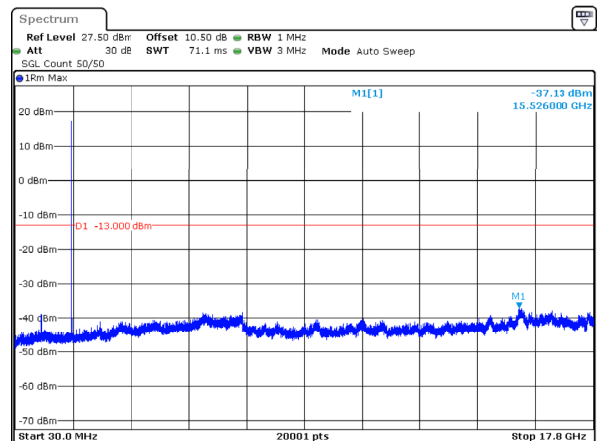


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:39:22

n66\_10MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@51 -37.27dBm

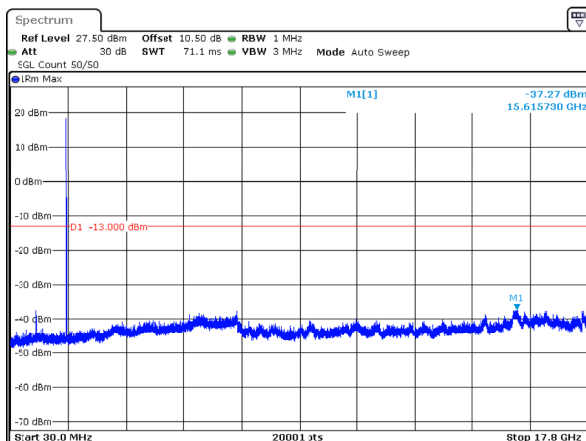


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:39:50

n66\_10MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB50@0 -36.97dBm

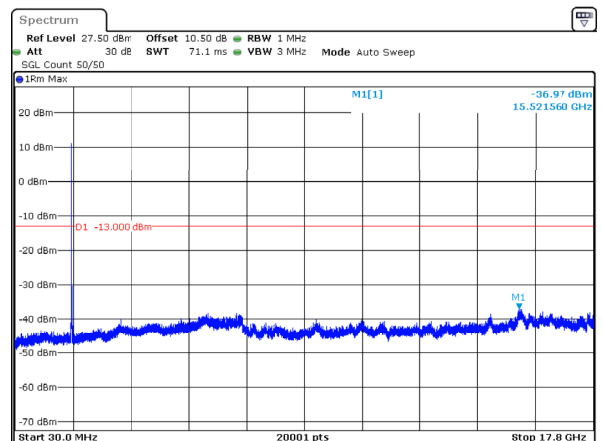


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:40:18

n66\_10MHz\_15kHz\_1775MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.58dBm

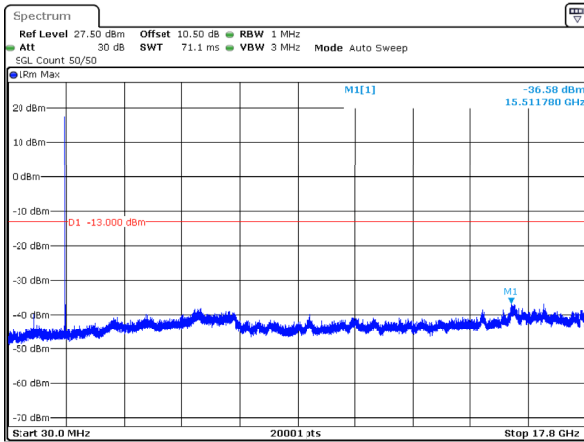


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:42:10

n66\_10MHz\_15kHz\_1775MHz\_DFT-s-OFDM  
QPSK\_RB1@51 -36.52dBm

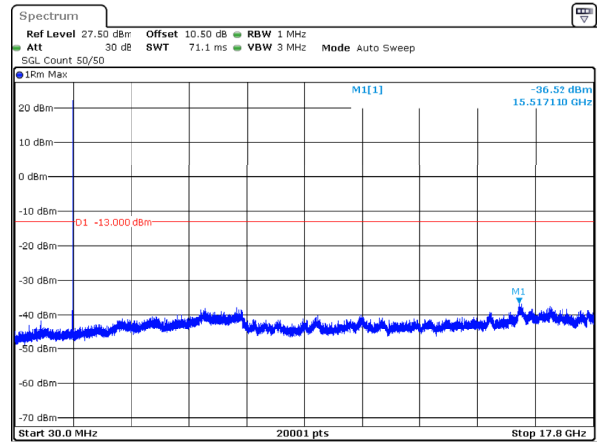


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:42:38

n66\_10MHz\_15kHz\_1775MHz\_DFT-s-OFDM  
QPSK\_RB50@0 -37.33dBm

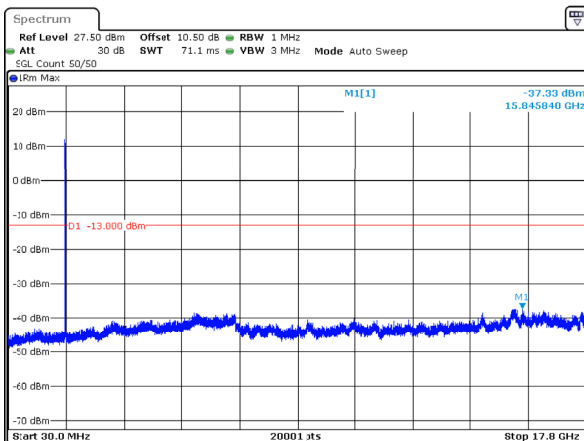


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:43:06

n66\_15MHz\_15kHz\_1717.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.15dBm

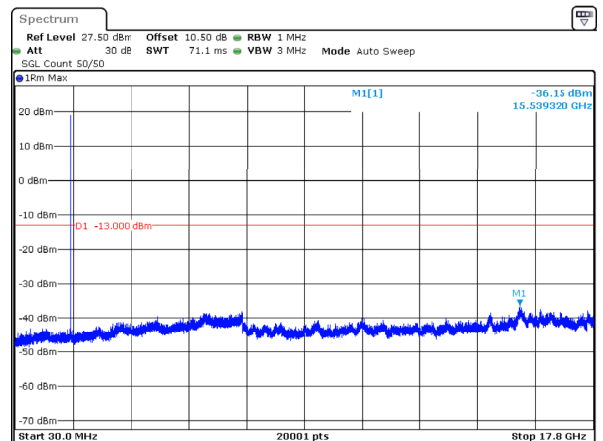


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:44:16

n66\_15MHz\_15kHz\_1717.5MHz\_DFT-s-OFDM  
QPSK\_RB1@78 -36.93dBm

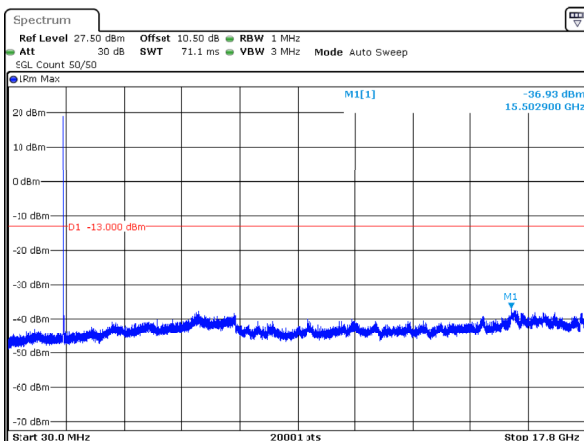


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:44:44

n66\_15MHz\_15kHz\_1717.5MHz\_DFT-s-OFDM  
QPSK\_RB75@0 -37.28dBm

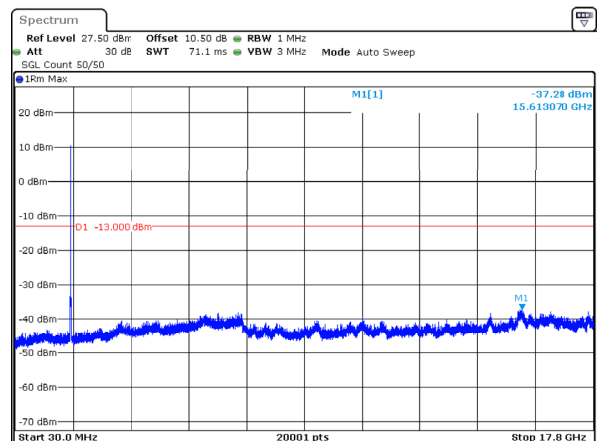


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:45:12

n66\_15MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.00dBm

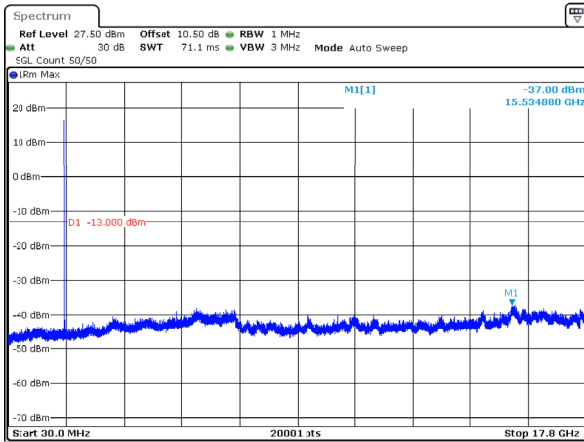


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:46:22

n66\_15MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@78 -36.90dBm

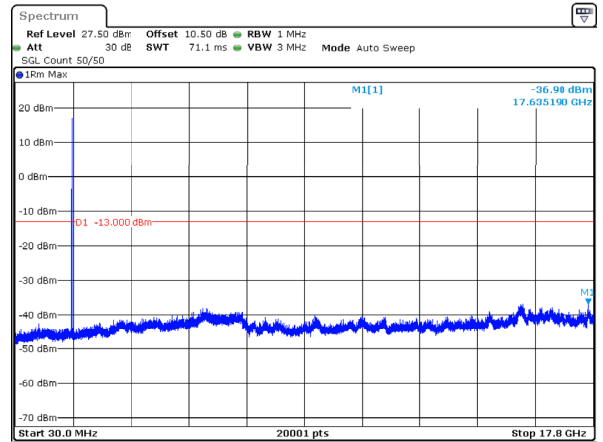


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:46:50

n66\_15MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB75@0 -36.28dBm

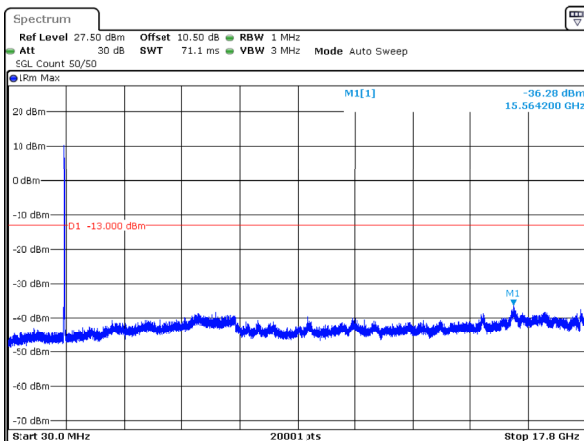


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:47:18

n66\_15MHz\_15kHz\_1772.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.13dBm

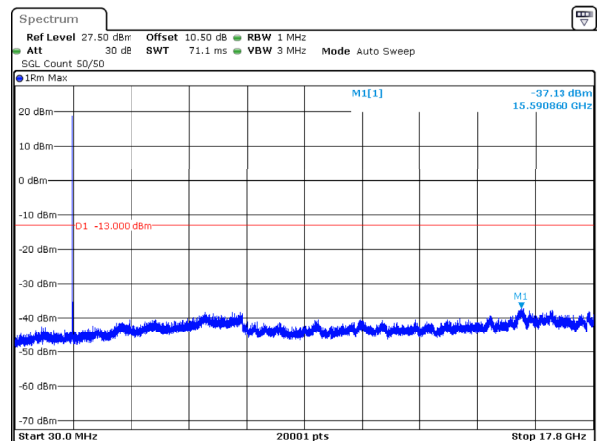


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:49:57

n66\_15MHz\_15kHz\_1772.5MHz\_DFT-s-OFDM  
QPSK\_RB1@78 -36.92dBm

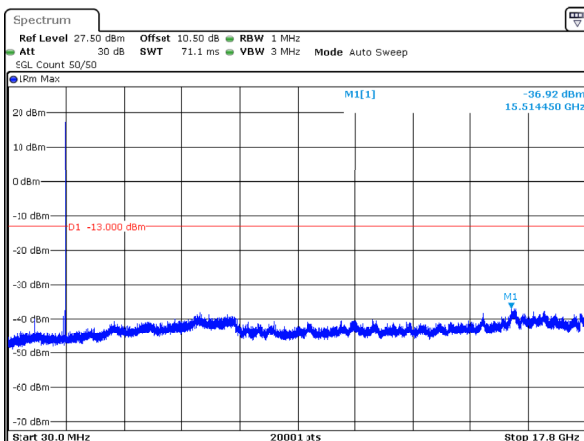


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:50:25

n66\_15MHz\_15kHz\_1772.5MHz\_DFT-s-OFDM  
QPSK\_RB75@0 -37.15dBm

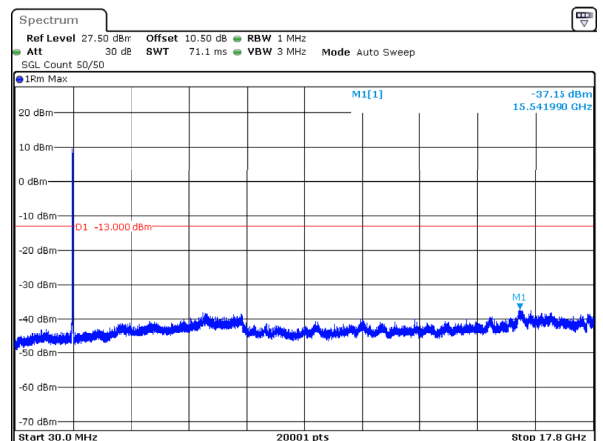


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:50:53

n66\_20MHz\_15kHz\_1720MHz\_DFT-s-OFDM  
QPSK\_RB100@0 -36.14dBm

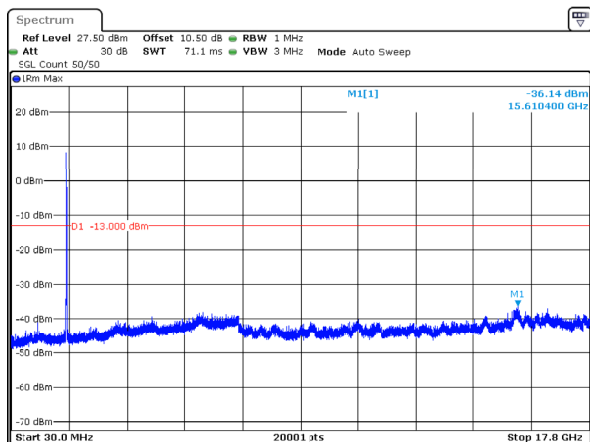


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:52:59

n66\_20MHz\_15kHz\_1720MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.07dBm

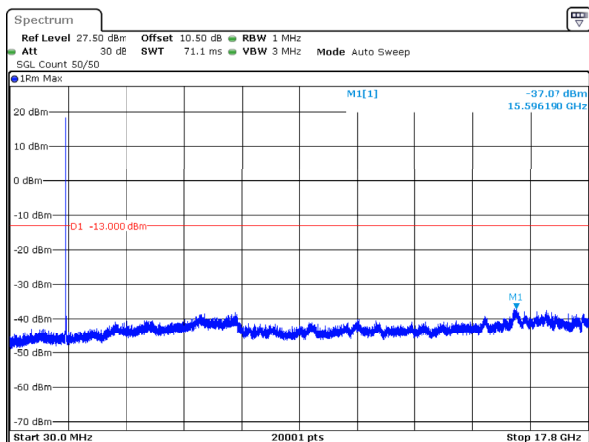


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:52:02

n66\_20MHz\_15kHz\_1720MHz\_DFT-s-OFDM  
QPSK\_RB1@105 -36.31dBm

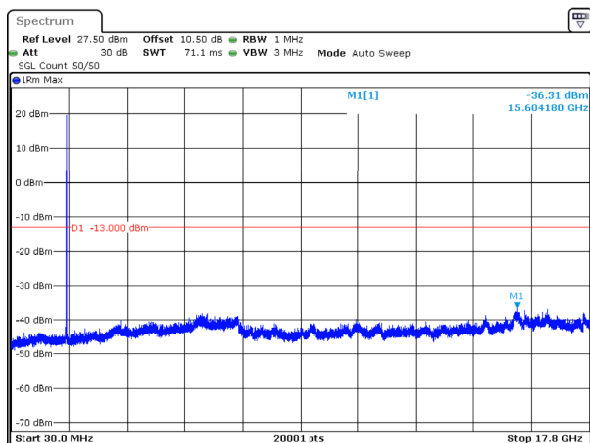


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:52:31

n66\_20MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB100@0 -36.98dBm

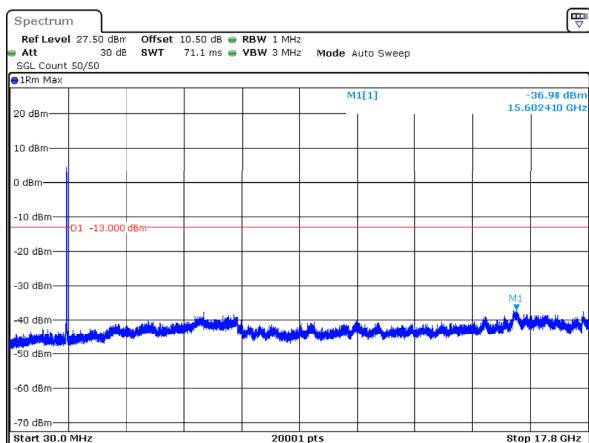


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:58:32

n66\_20MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.78dBm

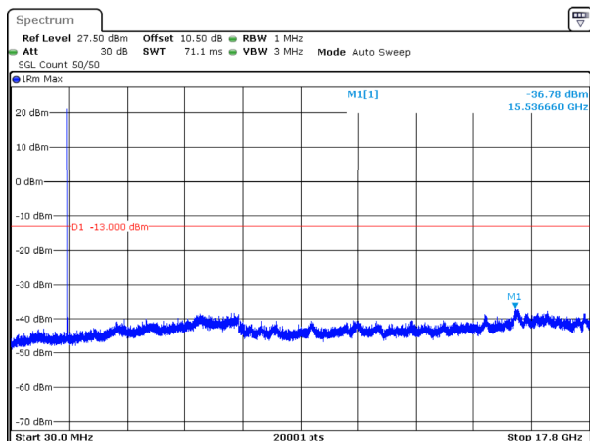


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:56:06

n66\_20MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@105 -36.93dBm

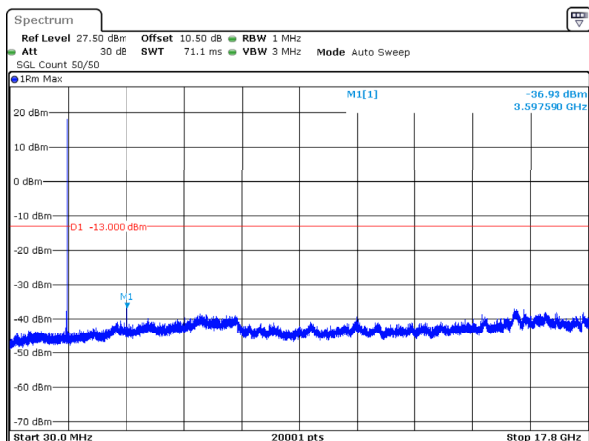


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 11:56:37

n66\_20MHz\_15kHz\_1770MHz\_DFT-s-OFDM  
QPSK\_RB100@0 -37.02dBm

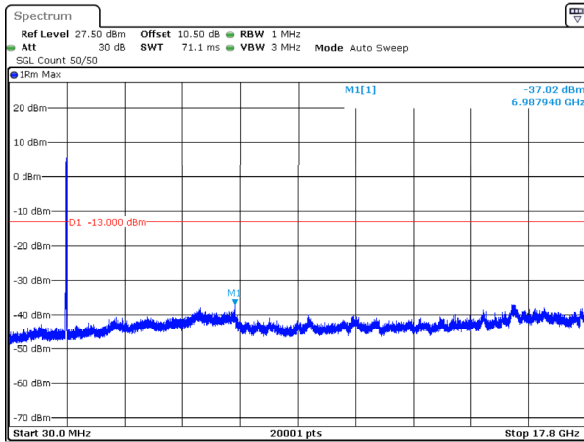


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:03:52

n66\_20MHz\_15kHz\_1770MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.18dBm

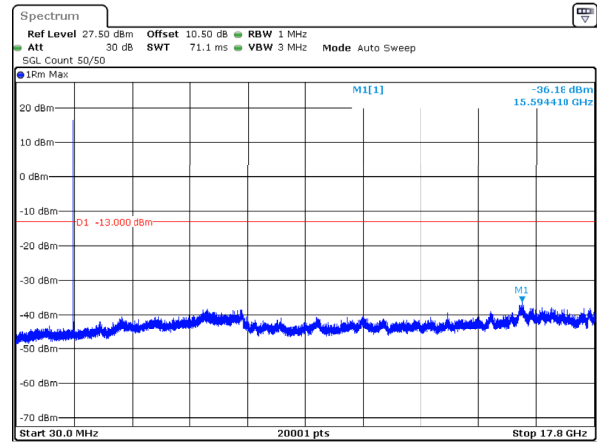


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:04:39

n66\_20MHz\_15kHz\_1770MHz\_DFT-s-OFDM  
QPSK\_RB1@105 -35.82dBm

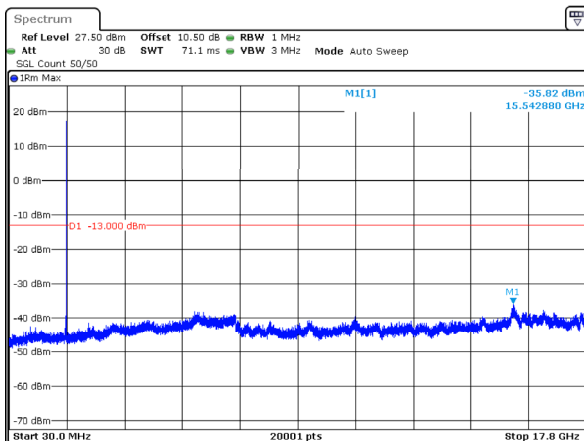


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:03:01

n66\_25MHz\_15kHz\_1722.5MHz\_DFT-s-OFDM  
QPSK\_RB128@0 -37.29dBm

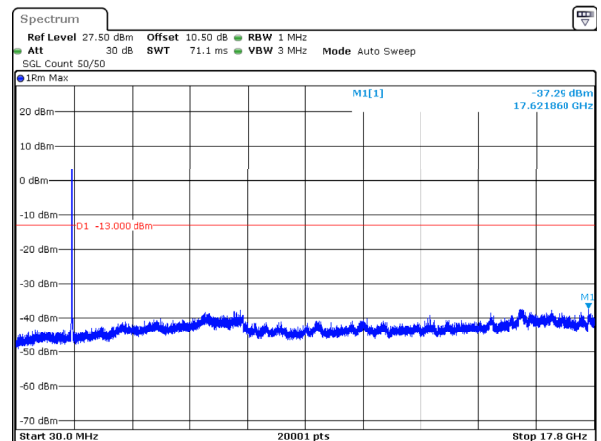


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:05:51

n66\_25MHz\_15kHz\_1722.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -37.15dBm

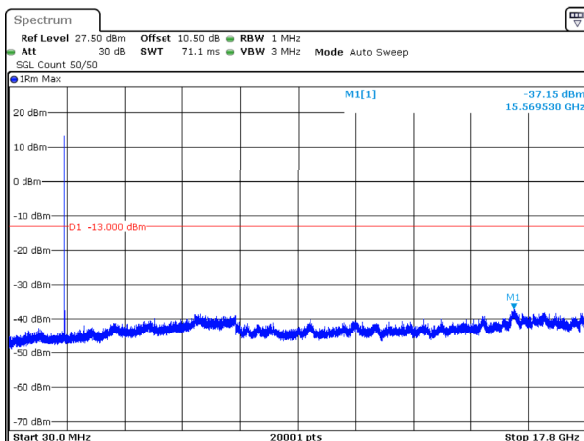


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:04:58

n66\_25MHz\_15kHz\_1722.5MHz\_DFT-s-OFDM  
QPSK\_RB1@132 -36.40dBm

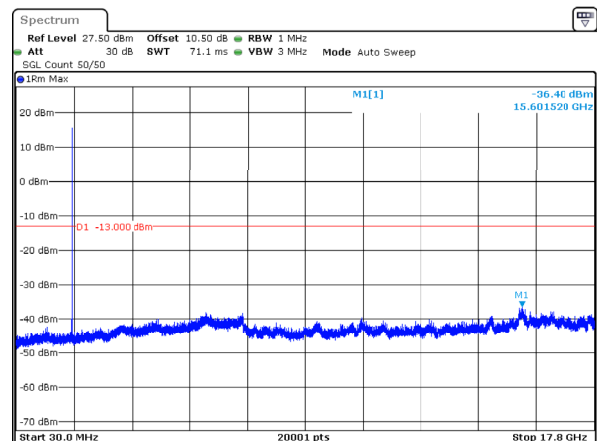


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:05:24

n66\_25MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB128@0 -36.69dBm

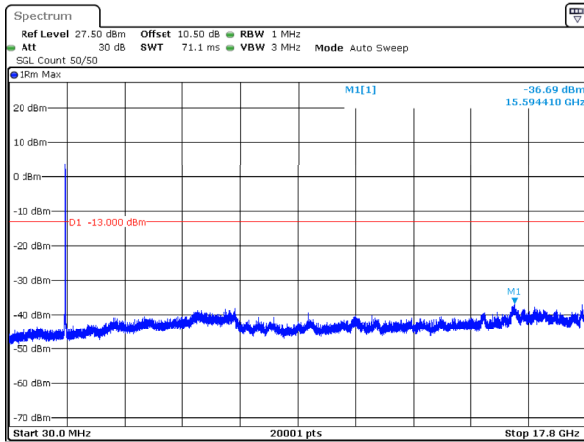


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:07:47

n66\_25MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.88dBm

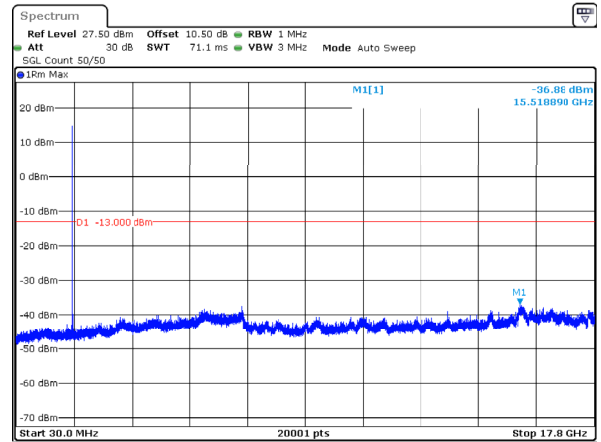


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:06:54

n66\_25MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@132 -35.97dBm

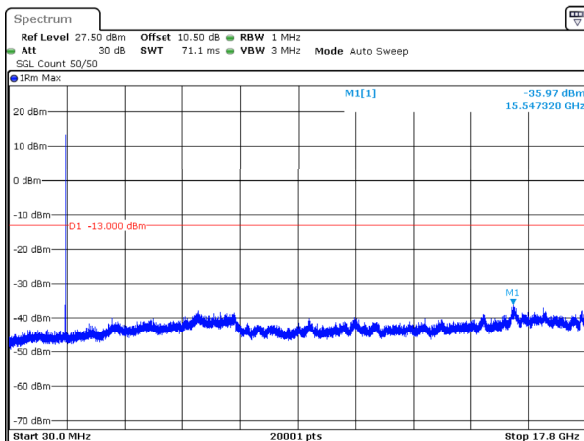


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:07:21

n66\_25MHz\_15kHz\_1767.5MHz\_DFT-s-OFDM  
QPSK\_RB128@0 -36.85dBm

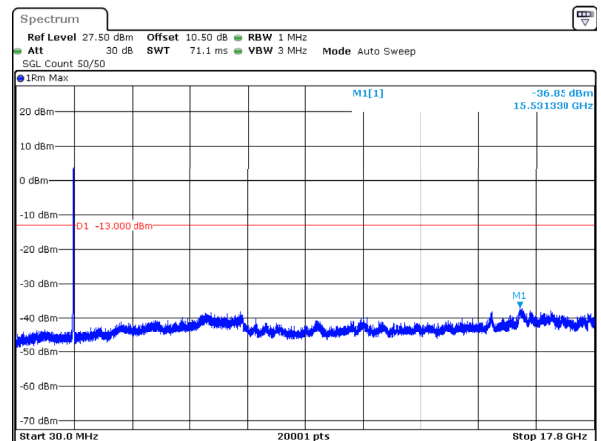


ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:09:46

n66\_25MHz\_15kHz\_1767.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0 -36.28dBm

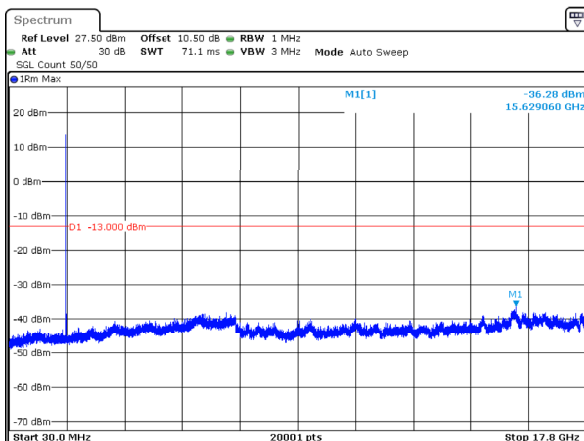

ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:08:54

n66\_25MHz\_15kHz\_1767.5MHz\_DFT-s-OFDM  
QPSK\_RB1@132 -36.28dBm

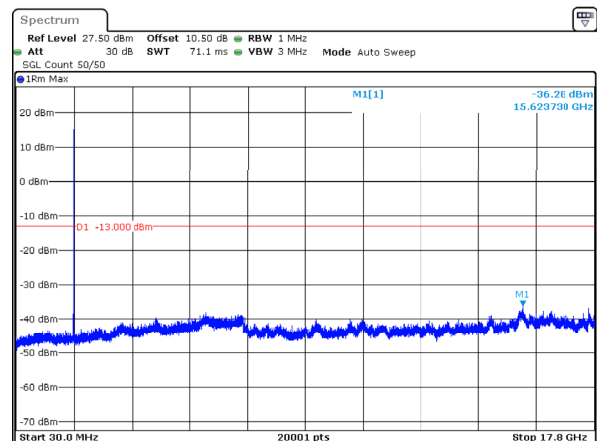

ProjectNo.:2401U81808E-RF Tester:Jim Cheng  
Date: 19.JUL.2024 12:09:20