



n77_3_20MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@0 -35.65dBm

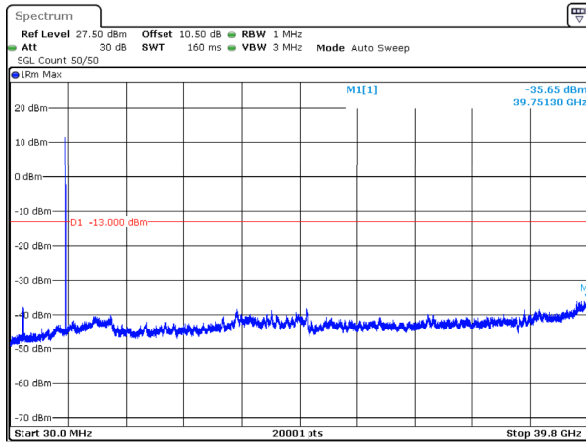


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:39:40

n77_3_20MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@50 -35.57dBm

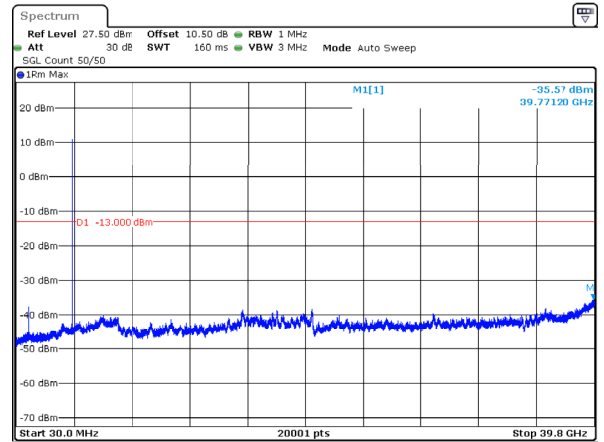


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:40:55

n77_3_20MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB50@0 -35.07dBm

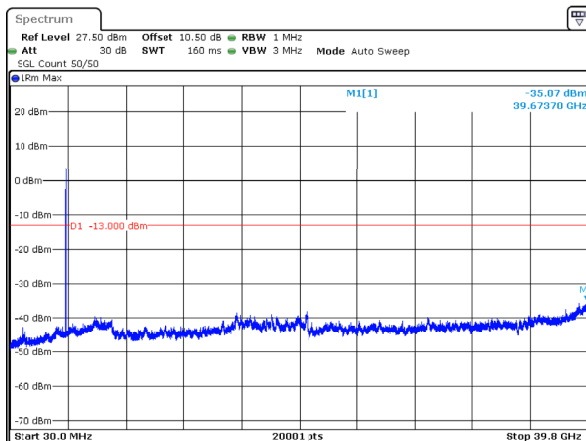


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:42:06

n77_3_20MHz_30kHz_3970MHz_DFT-s-OFDM
QPSK_RB1@0 -35.57dBm

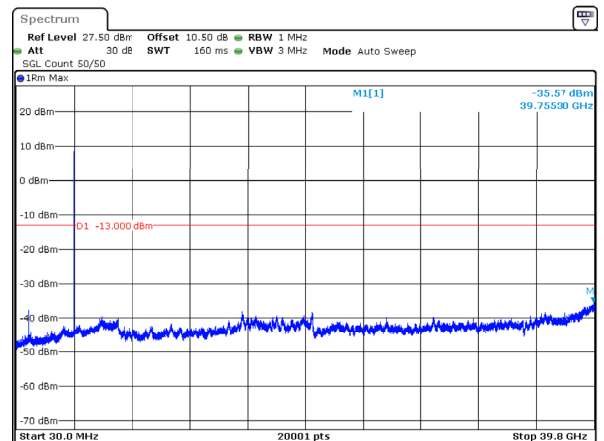


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:43:26

n77_3_20MHz_30kHz_3970MHz_DFT-s-OFDM
QPSK_RB1@50 -35.53dBm

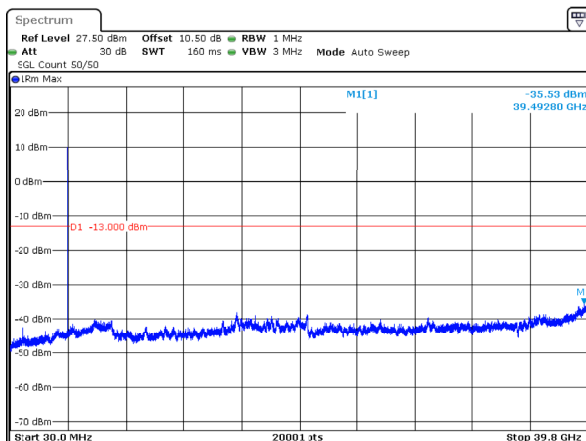


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:44:25

n77_3_20MHz_30kHz_3970MHz_DFT-s-OFDM
QPSK_RB50@0 -35.51dBm

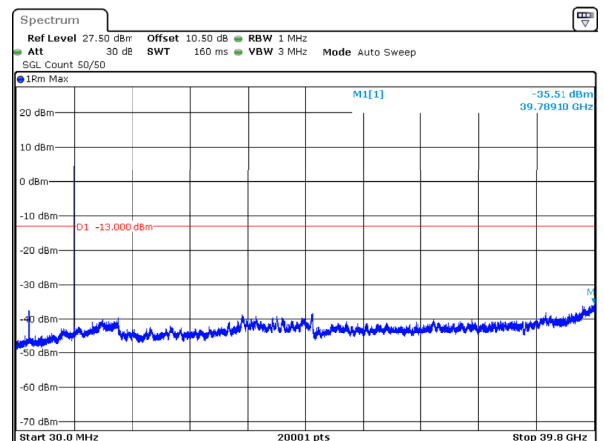


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:45:44

n77_3_30MHz_30kHz_3715MHz_DFT-s-OFDM
QPSK_RB1@0 -36.20dBm

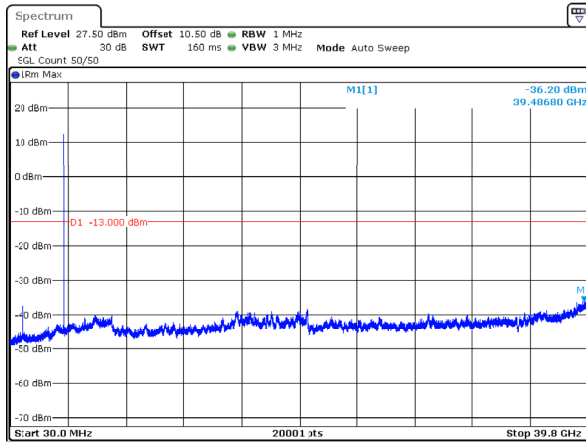


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:46:44

n77_3_30MHz_30kHz_3715MHz_DFT-s-OFDM
QPSK_RB1@77 -35.71dBm

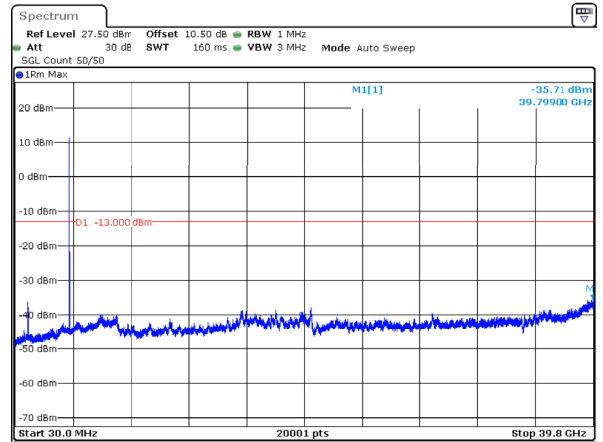


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:47:47

n77_3_30MHz_30kHz_3715MHz_DFT-s-OFDM
QPSK_RB75@0 -35.81dBm

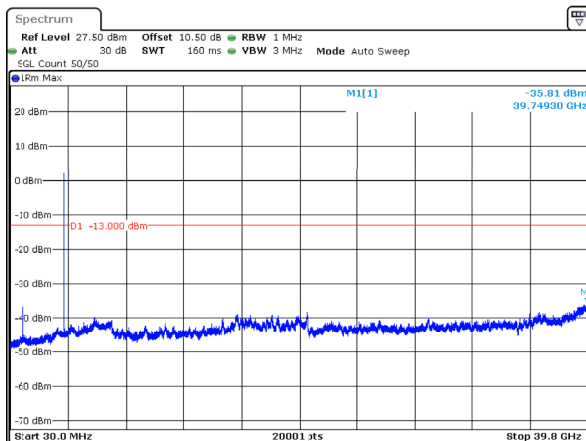


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:49:02

n77_3_30MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@0 -35.79dBm

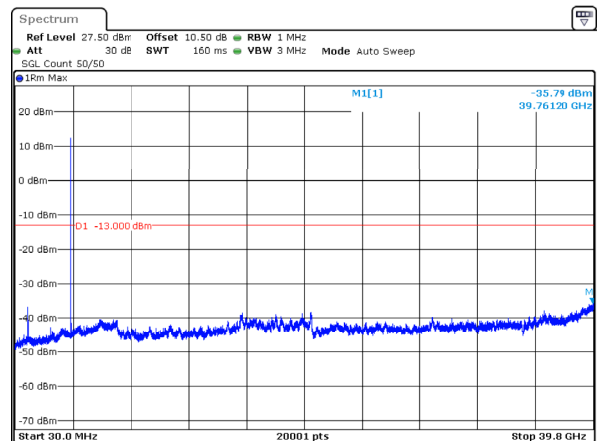


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:50:23

n77_3_30MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@77 -35.55dBm

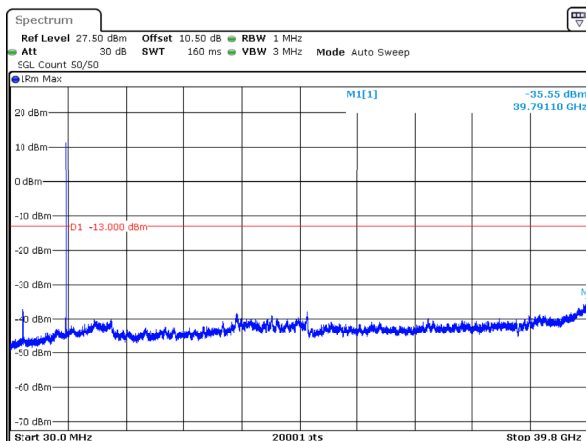


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:51:23

n77_3_30MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB75@0 -35.97dBm

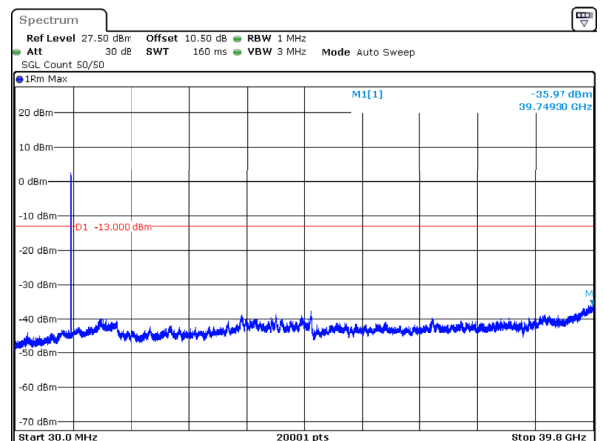


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:52:40

n77_3_30MHz_30kHz_3965MHz_DFT-s-OFDM
QPSK_RB1@0 -35.10dBm

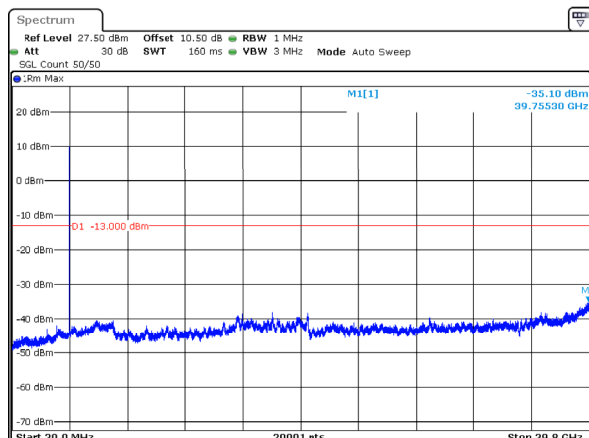


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:54:00

n77_3_30MHz_30kHz_3965MHz_DFT-s-OFDM
QPSK_RB1@77 -35.64dBm

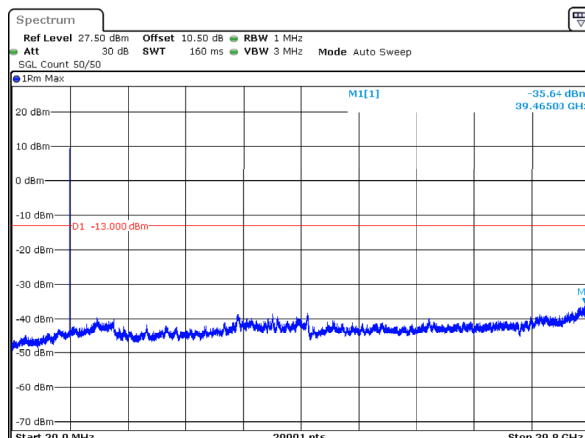


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:55:00

n77_3_30MHz_30kHz_3965MHz_DFT-s-OFDM
QPSK_RB75@0 -35.47dBm

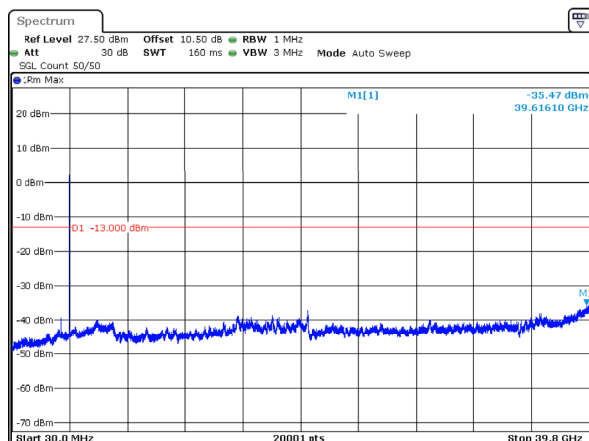


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:56:00

n77_3_40MHz_30kHz_3720MHz_DFT-s-OFDM
QPSK_RB100@0 -35.60dBm

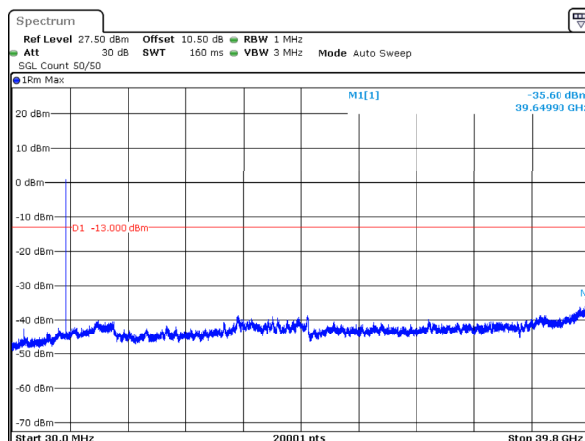


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:59:16

n77_3_40MHz_30kHz_3720MHz_DFT-s-OFDM
QPSK_RB1@0 -35.87dBm

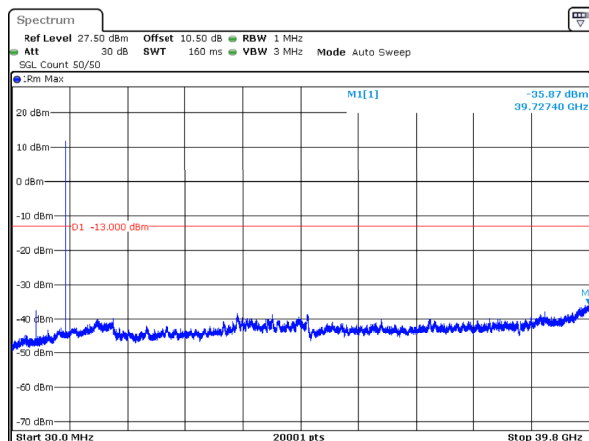


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:57:17

n77_3_40MHz_30kHz_3720MHz_DFT-s-OFDM
QPSK_RB1@105 -35.46dBm

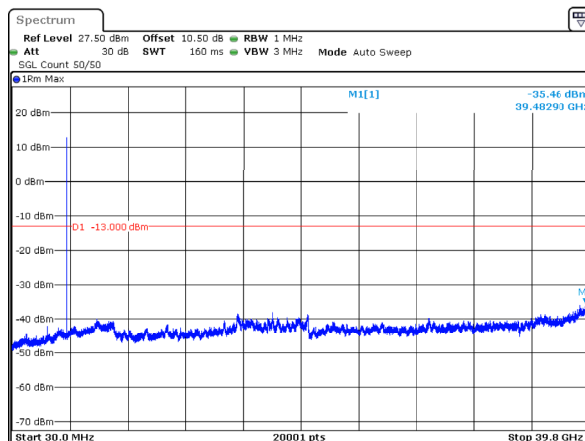


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:58:15

n77_3_40MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB100@0 -35.66dBm

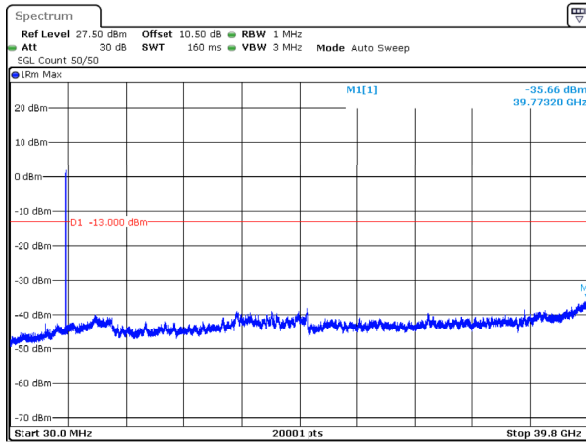


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:02:36

n77_3_40MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@0 -35.78dBm

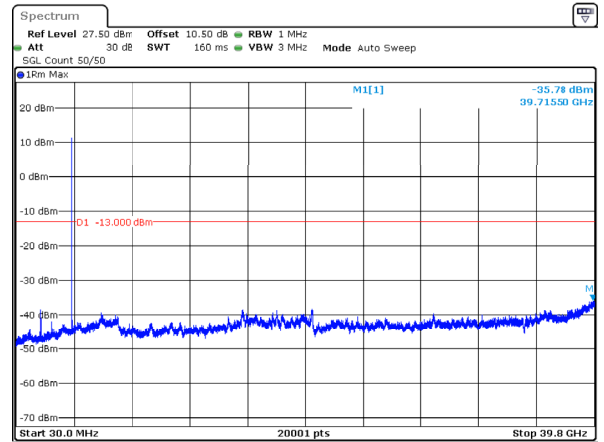


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:00:36

n77_3_40MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@105 -35.09dBm

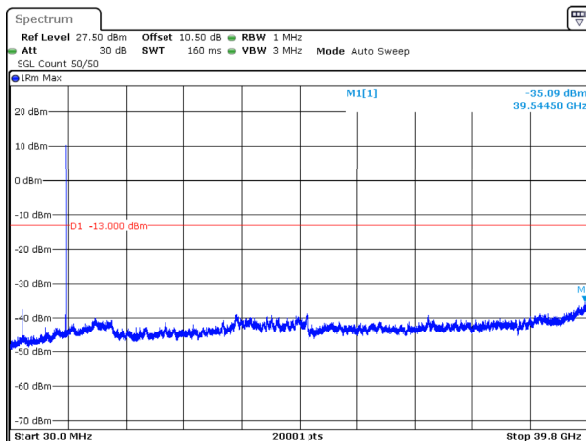


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:01:36

n77_3_40MHz_30kHz_3960MHz_DFT-s-OFDM
QPSK_RB100@0 -35.65dBm

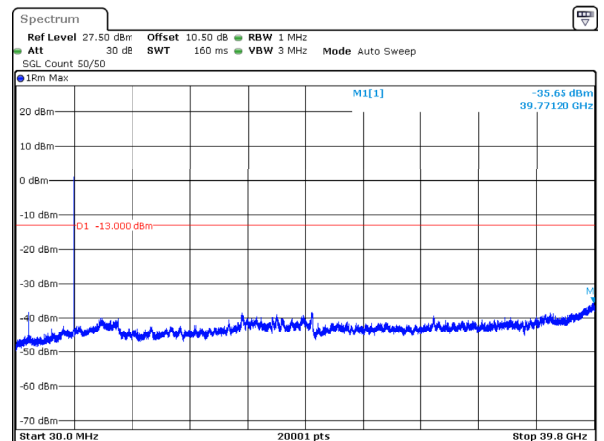


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:06:18

n77_3_40MHz_30kHz_3960MHz_DFT-s-OFDM
QPSK_RB1@0 -35.70dBm

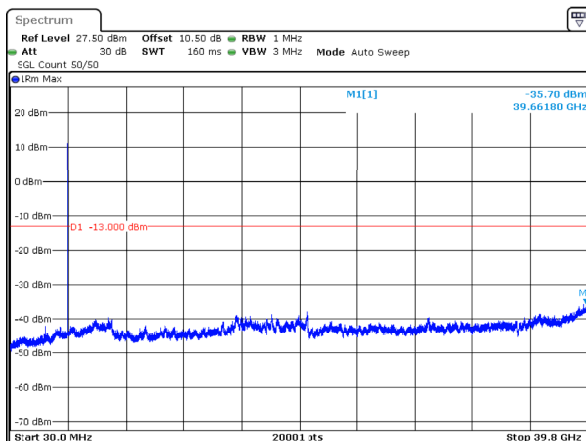


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:04:00

n77_3_40MHz_30kHz_3960MHz_DFT-s-OFDM
QPSK_RB1@105 -35.36dBm

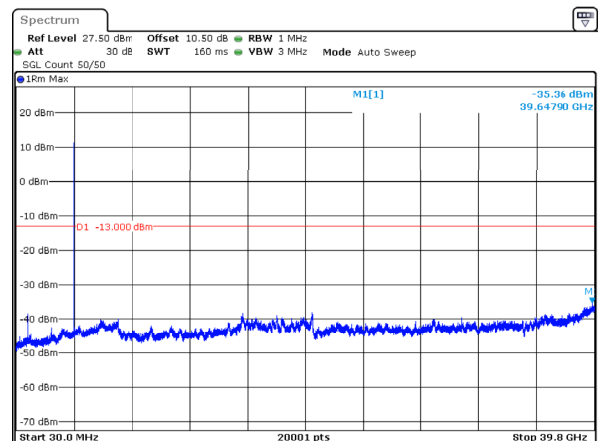


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:05:18

n77_3_50MHz_30kHz_3725MHz_DFT-s-OFDM
QPSK_RB128@0 -35.51dBm

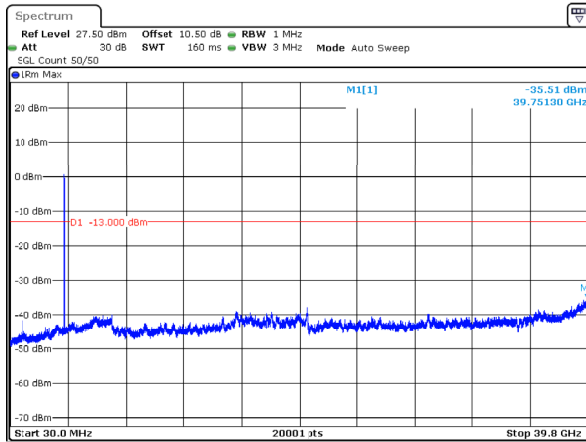


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:09:19

n77_3_50MHz_30kHz_3725MHz_DFT-s-OFDM
QPSK_RB1@0 -35.86dBm

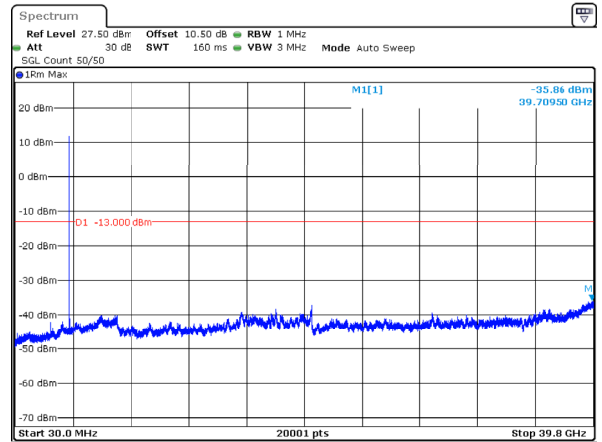


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:07:18

n77_3_50MHz_30kHz_3725MHz_DFT-s-OFDM
QPSK_RB1@132 -35.68dBm

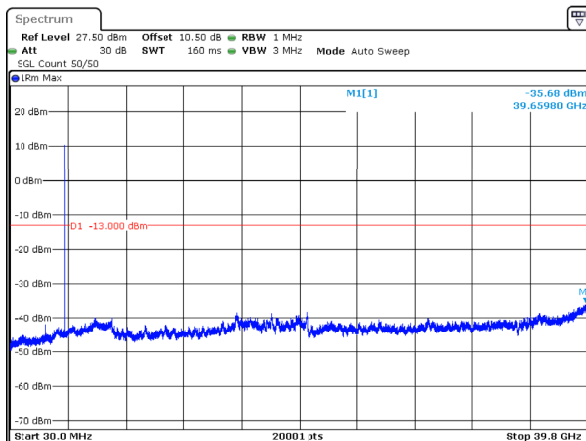


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:08:19

n77_3_50MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB128@0 -35.36dBm

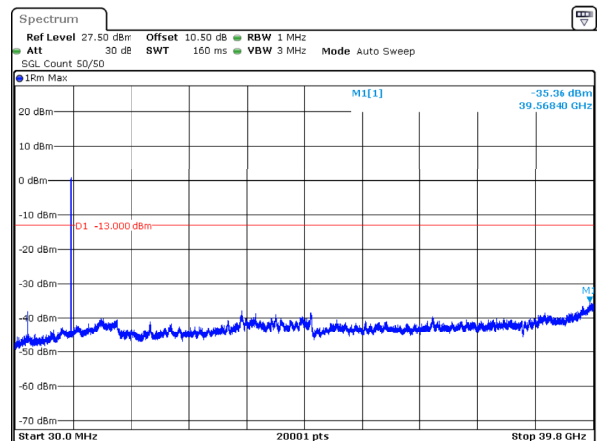


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:12:59

n77_3_50MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@0 -35.60dBm

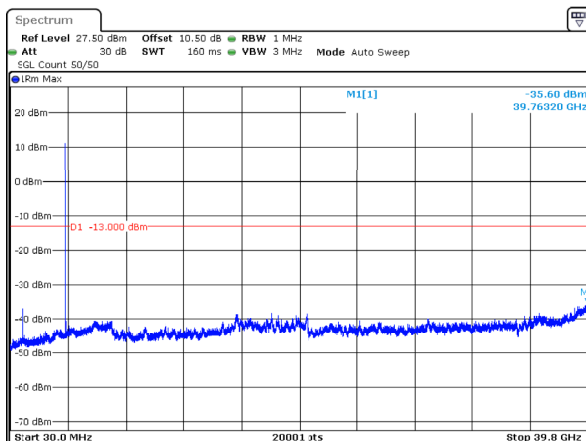


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:10:40

n77_3_50MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@132 -35.53dBm

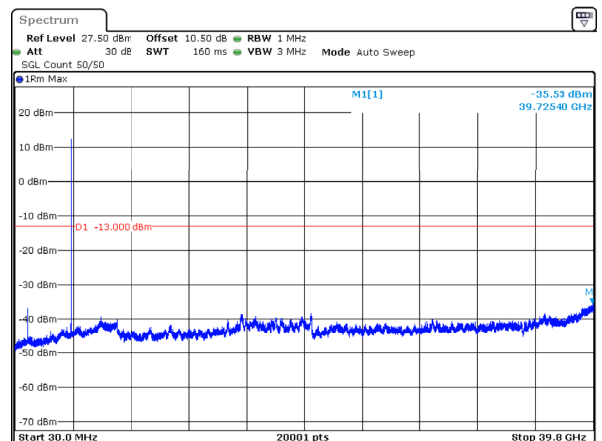


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:11:40

n77_3_50MHz_30kHz_3955MHz_DFT-s-OFDM
QPSK_RB128@0 -36.02dBm

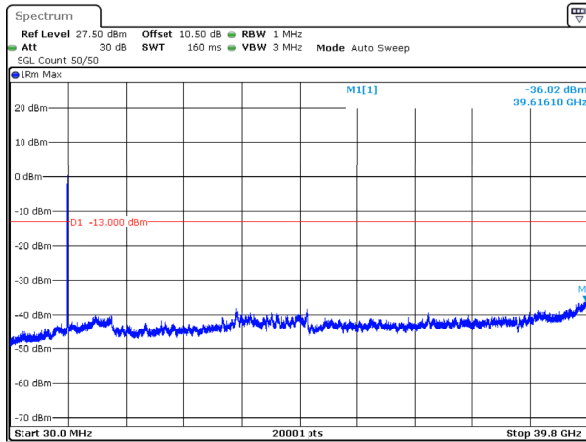


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:16:50

n77_3_50MHz_30kHz_3955MHz_DFT-s-OFDM
QPSK_RB1@0 -35.41dBm

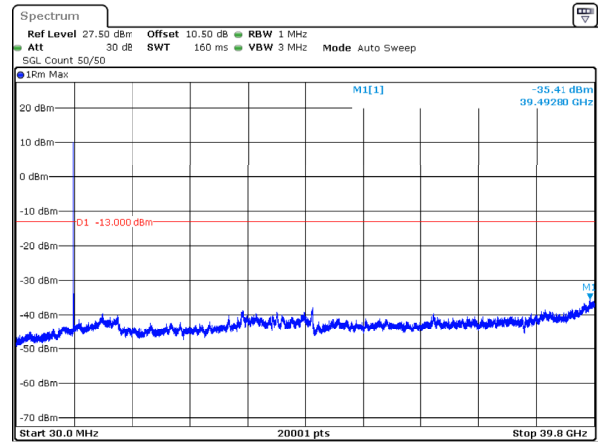


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:14:19

n77_3_50MHz_30kHz_3955MHz_DFT-s-OFDM
QPSK_RB1@132 -35.65dBm

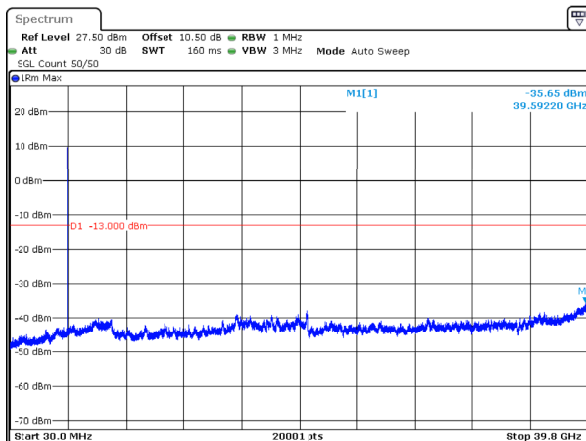


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:15:33

n77_3_60MHz_30kHz_3730MHz_DFT-s-OFDM
QPSK_RB162@0 -35.28dBm

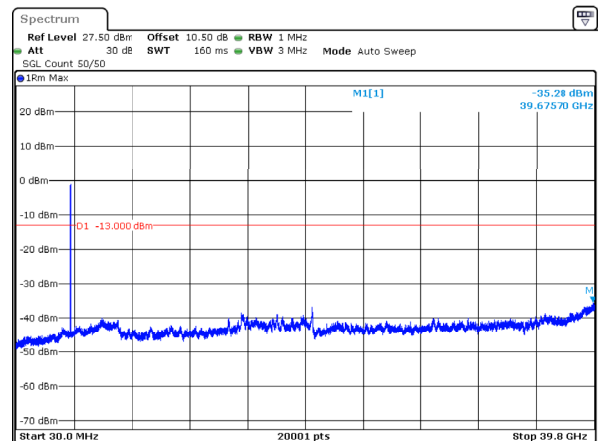


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:20:17

n77_3_60MHz_30kHz_3730MHz_DFT-s-OFDM
QPSK_RB1@0 -35.93dBm

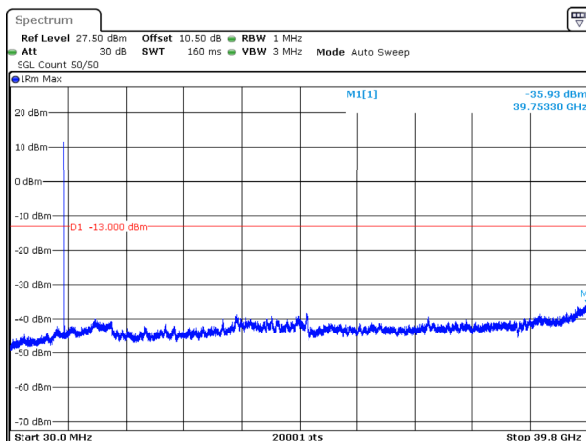


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:17:49

n77_3_60MHz_30kHz_3730MHz_DFT-s-OFDM
QPSK_RB1@161 -35.68dBm

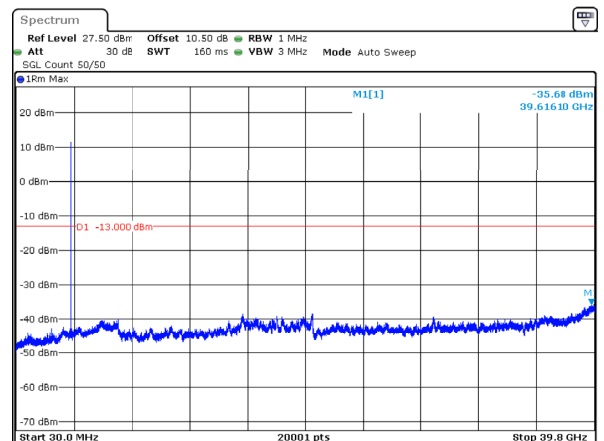


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:19:06

n77_3_60MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB162@0 -35.63dBm

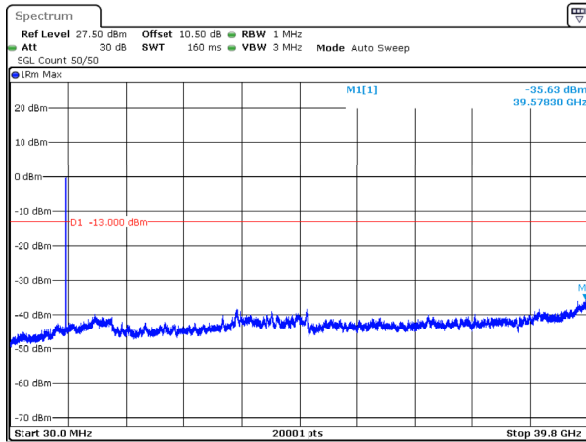


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:24:25

n77_3_60MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@0 -35.81dBm

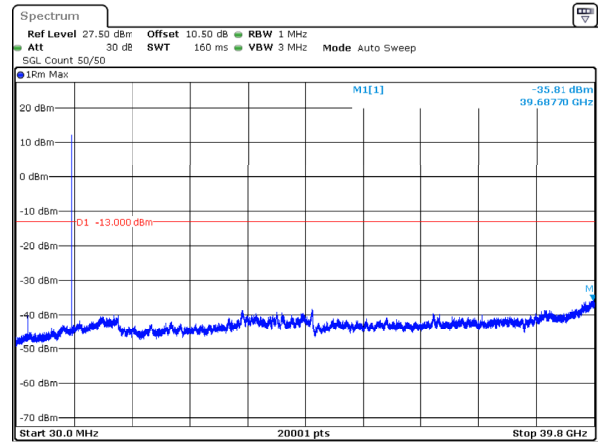


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:21:37

n77_3_60MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@161 -35.74dBm

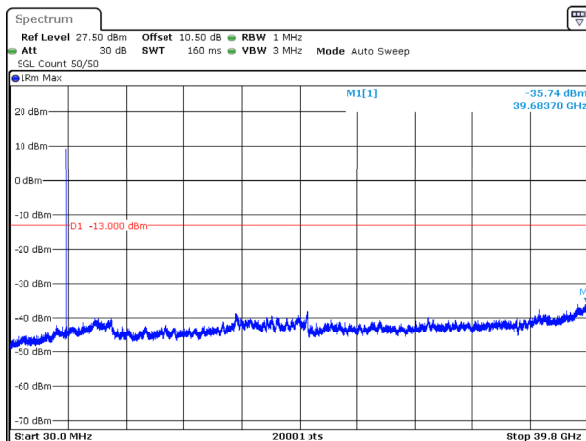


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:23:07

n77_3_60MHz_30kHz_3950MHz_DFT-s-OFDM
QPSK_RB162@0 -35.58dBm

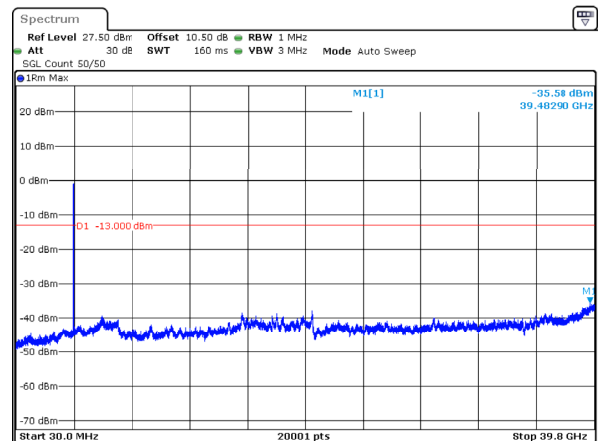


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:28:01

n77_3_60MHz_30kHz_3950MHz_DFT-s-OFDM
QPSK_RB1@0 -35.85dBm

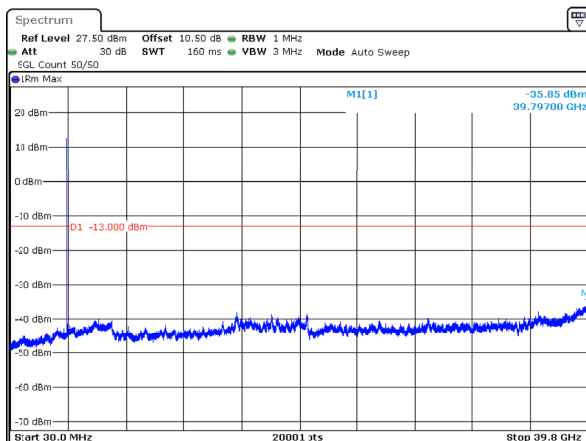


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:25:45

n77_3_60MHz_30kHz_3950MHz_DFT-s-OFDM
QPSK_RB1@161 -35.29dBm

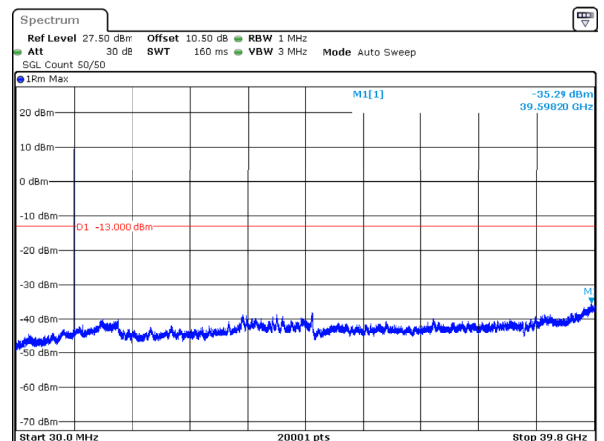


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:26:44

n77_3_70MHz_30kHz_3735MHz_DFT-s-OFDM
QPSK_RB180@0 -35.29dBm

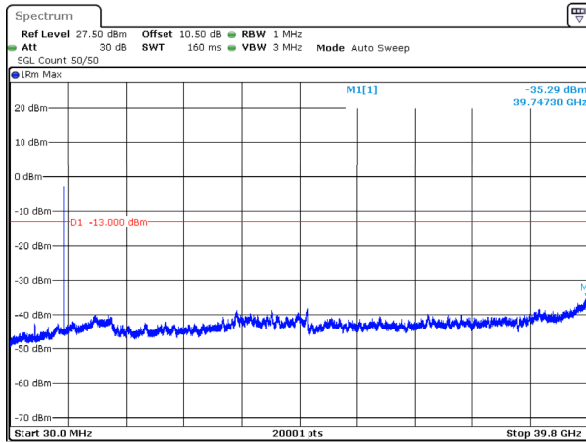


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:31:59

n77_3_70MHz_30kHz_3735MHz_DFT-s-OFDM
QPSK_RB1@0 -35.77dBm

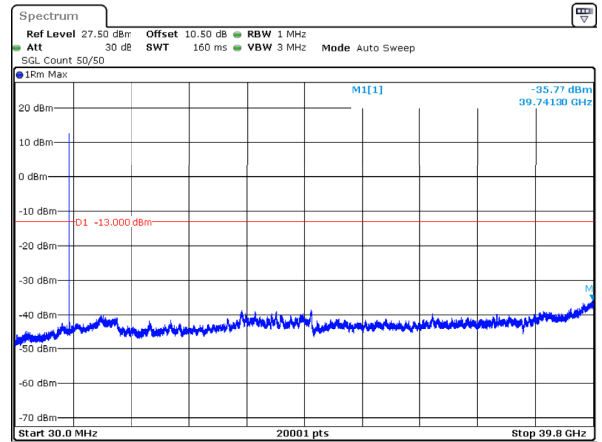


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:29:31

n77_3_70MHz_30kHz_3735MHz_DFT-s-OFDM
QPSK_RB1@188 -35.44dBm

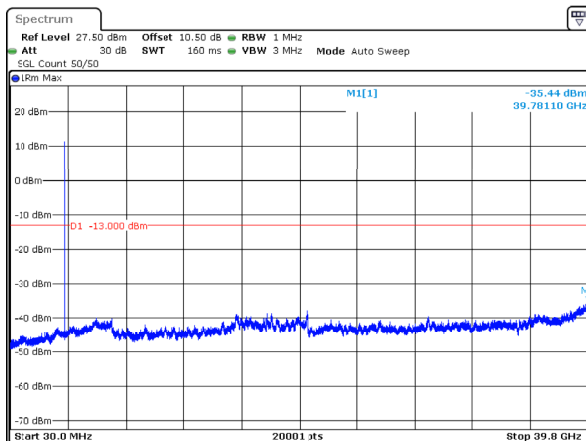


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:30:42

n77_3_70MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB180@0 -34.84dBm

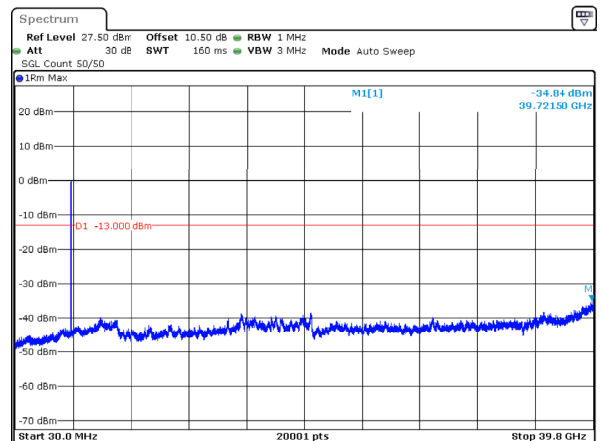


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:35:53

n77_3_70MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@0 -35.54dBm

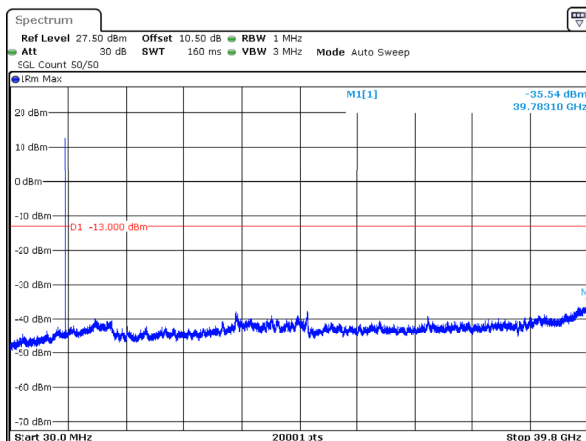


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:33:19

n77_3_70MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@188 -35.39dBm

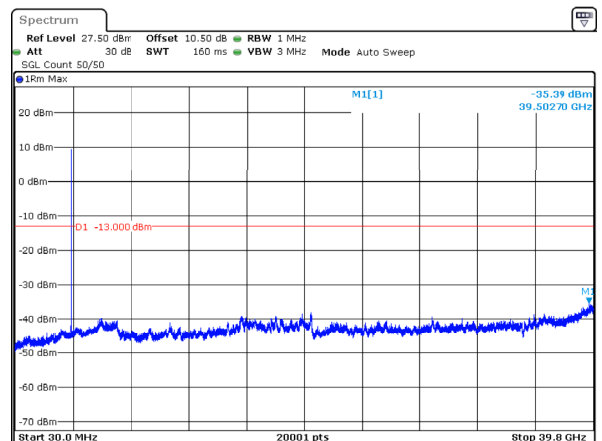


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:34:33

n77_3_70MHz_30kHz_3945MHz_DFT-s-OFDM
QPSK_RB180@0 -35.56dBm

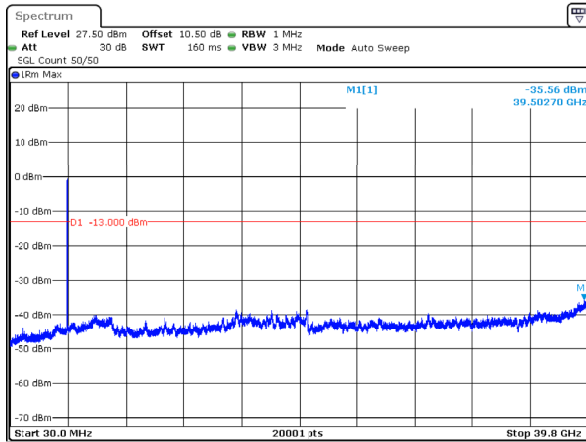


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:39:28

n77_3_70MHz_30kHz_3945MHz_DFT-s-OFDM
QPSK_RB1@0 -35.38dBm

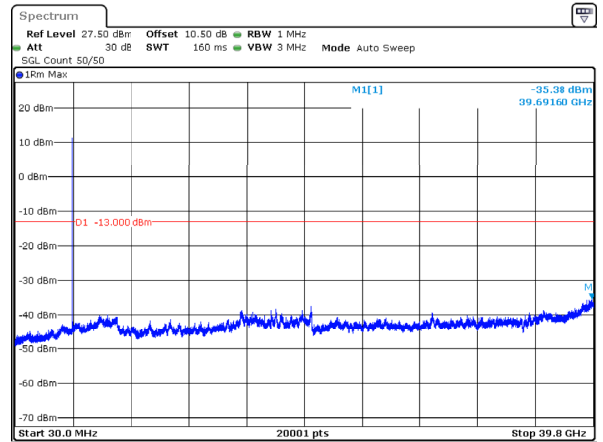


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:37:15

n77_3_70MHz_30kHz_3945MHz_DFT-s-OFDM
QPSK_RB1@188 -35.31dBm

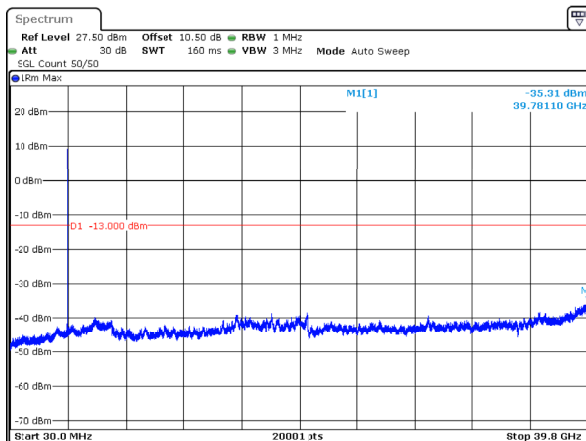


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:38:15

n77_3_80MHz_30kHz_3740MHz_DFT-s-OFDM
QPSK_RB1@0 -35.53dBm

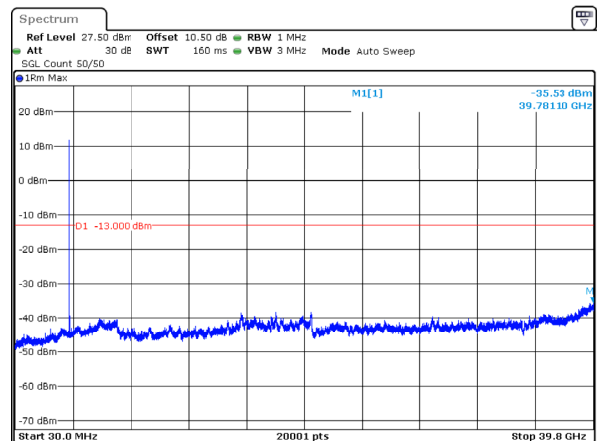


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:40:28

n77_3_80MHz_30kHz_3740MHz_DFT-s-OFDM
QPSK_RB1@216 -35.72dBm

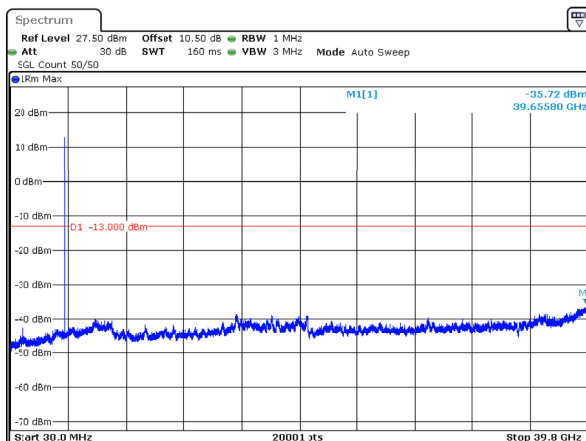


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:41:40

n77_3_80MHz_30kHz_3740MHz_DFT-s-OFDM
QPSK_RB216@0 -35.04dBm

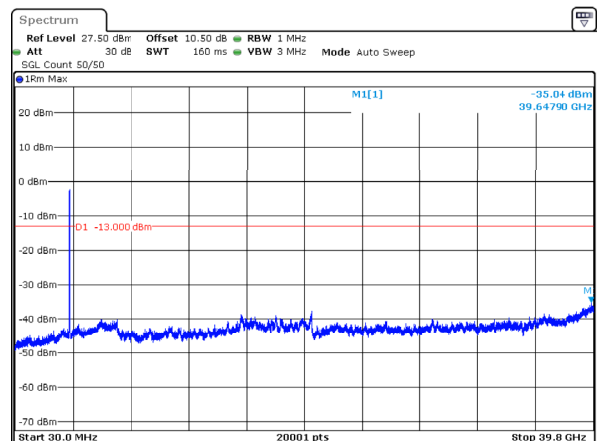


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:42:54

n77_3_80MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@0 -35.12dBm

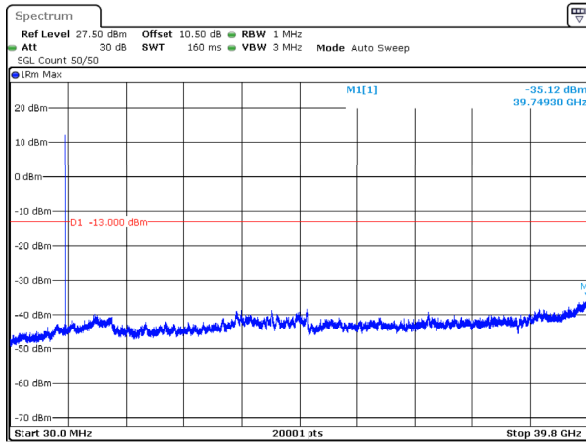


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:44:14

n77_3_80MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@216 -35.78dBm

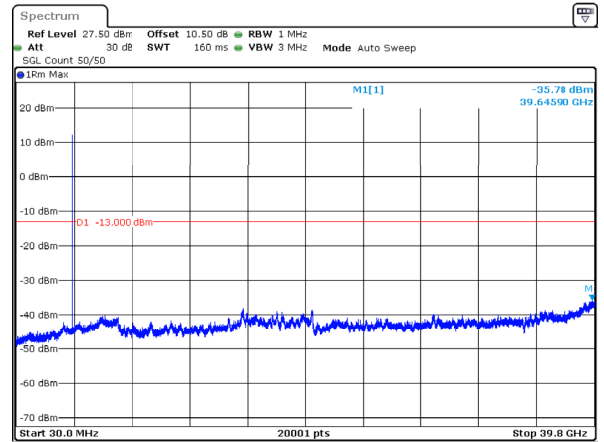


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:45:14

n77_3_80MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB216@0 -35.38dBm

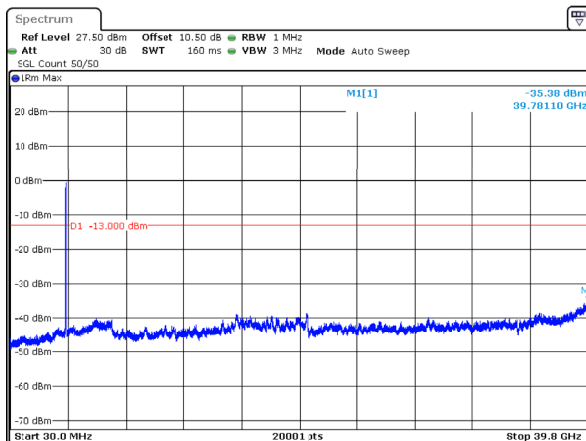


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:46:25

n77_3_80MHz_30kHz_3940MHz_DFT-s-OFDM
QPSK_RB1@0 -35.39dBm

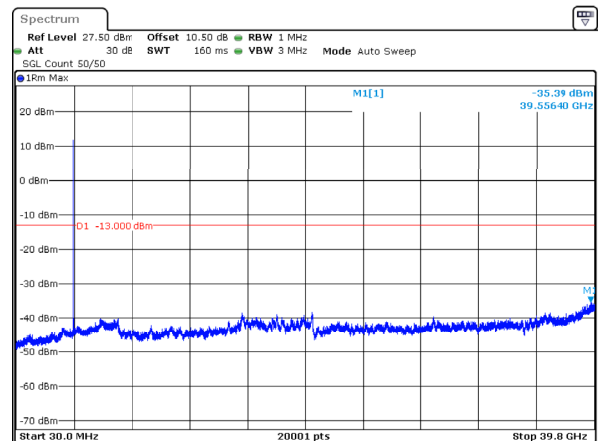


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:47:46

n77_3_80MHz_30kHz_3940MHz_DFT-s-OFDM
QPSK_RB1@216 -35.62dBm

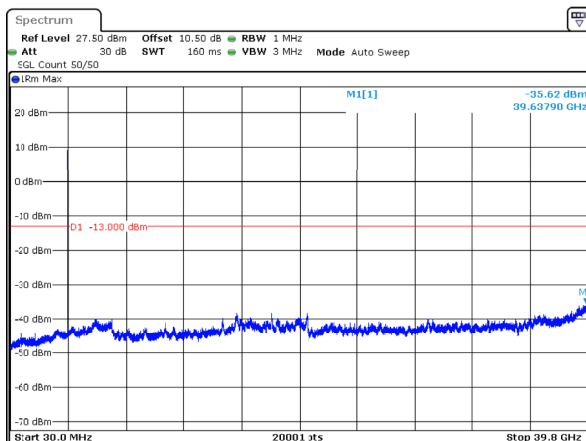


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:48:45

n77_3_80MHz_30kHz_3940MHz_DFT-s-OFDM
QPSK_RB216@0 -35.93dBm

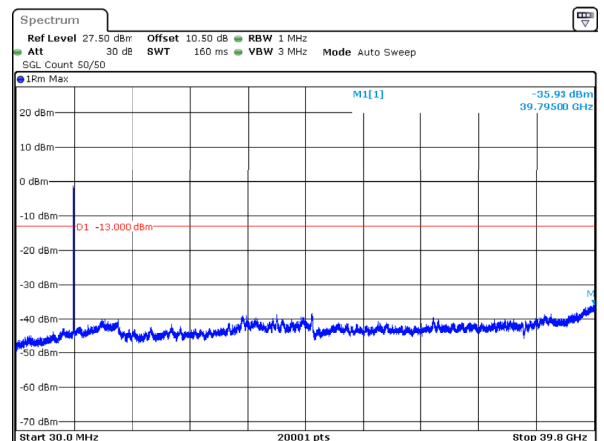


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:49:56

n77_3_90MHz_30kHz_3745MHz_DFT-s-OFDM
QPSK_RB1@0 -35.68dBm

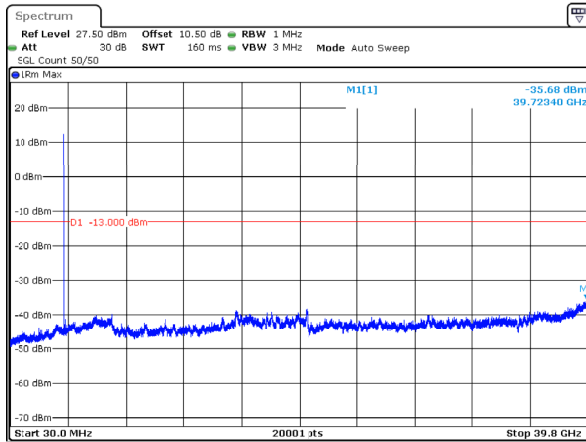


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:51:07

n77_3_90MHz_30kHz_3745MHz_DFT-s-OFDM
QPSK_RB1@244 -35.93dBm

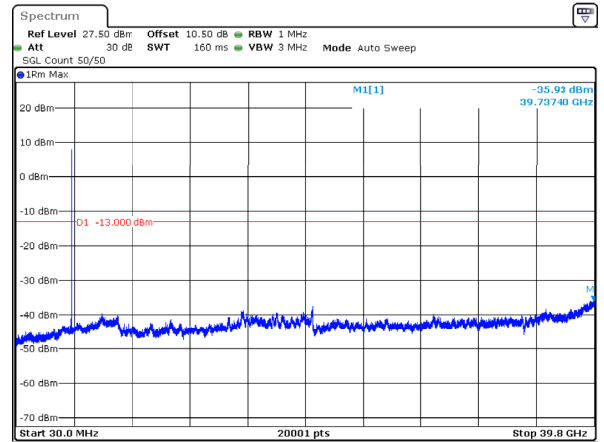


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:52:18

n77_3_90MHz_30kHz_3745MHz_DFT-s-OFDM
QPSK_RB243@0 -35.86dBm

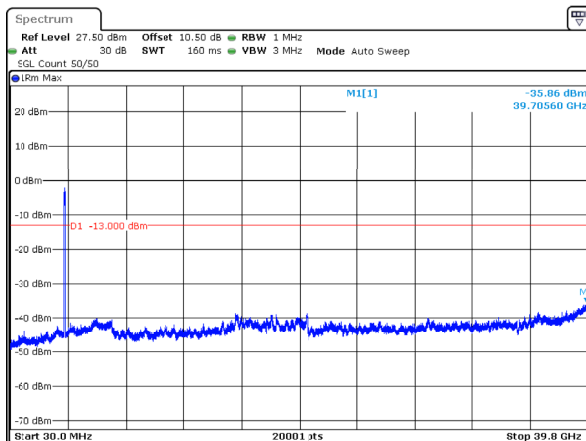


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:53:17

n77_3_90MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@0 -35.83dBm

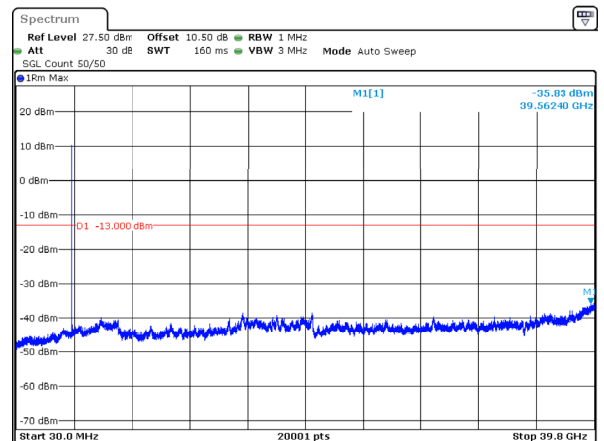


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:54:38

n77_3_90MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@244 -35.93dBm

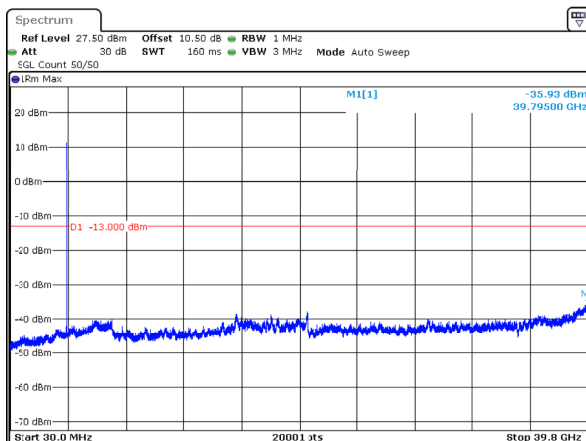


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:55:37

n77_3_90MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB243@0 -35.96dBm

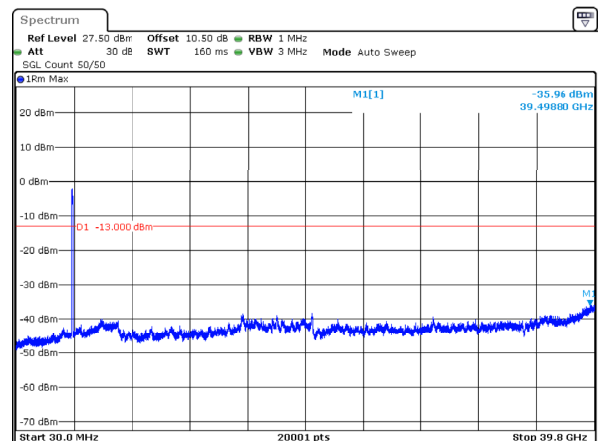


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:56:36

n77_3_90MHz_30kHz_3935MHz_DFT-s-OFDM
QPSK_RB1@0 -35.60dBm

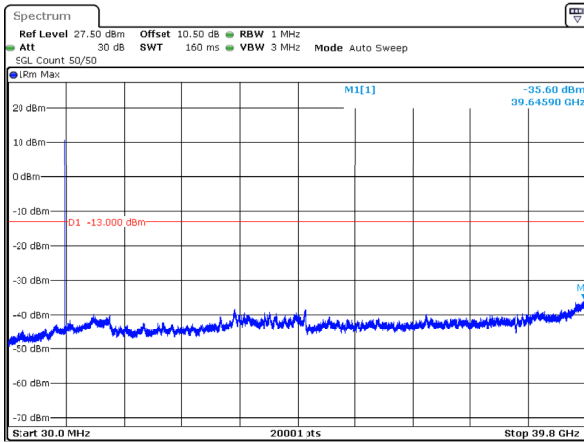


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:57:53

n77_3_90MHz_30kHz_3935MHz_DFT-s-OFDM
QPSK_RB1@244 -35.76dBm

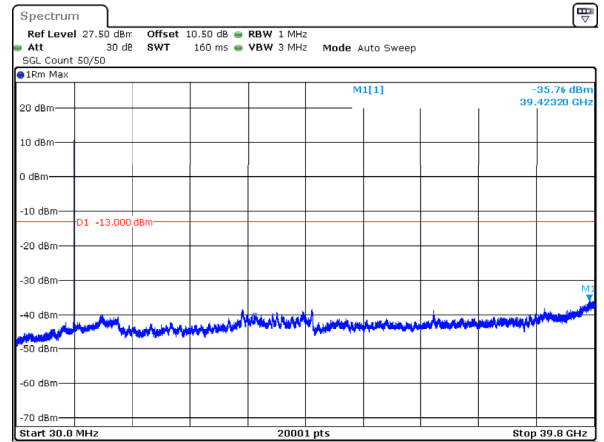


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:58:53

n77_3_90MHz_30kHz_3935MHz_DFT-s-OFDM
QPSK_RB243@0 -35.93dBm

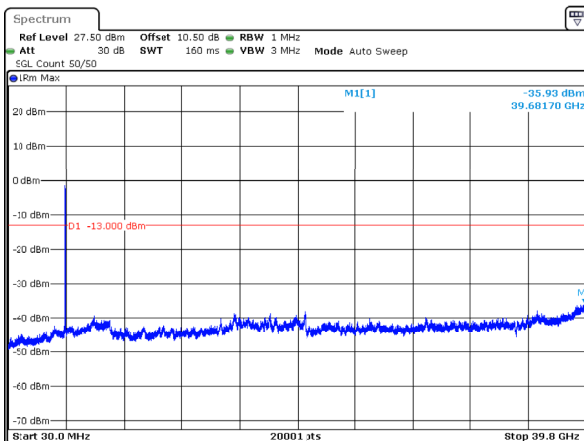


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 18:59:53

n77_3_100MHz_30kHz_3750MHz_DFT-s-OFDM
QPSK_RB1@0 -35.55dBm

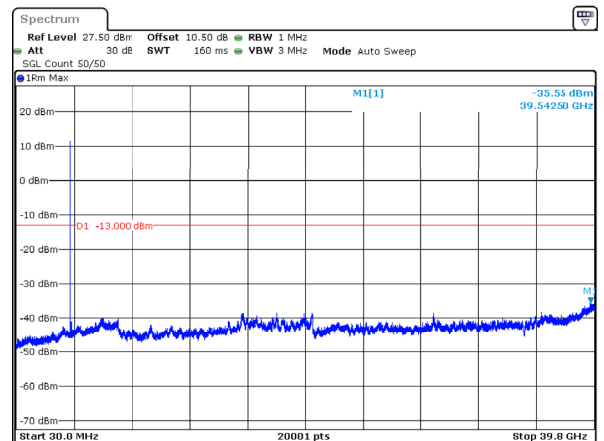


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:01:08

n77_3_100MHz_30kHz_3750MHz_DFT-s-OFDM
QPSK_RB1@272 -35.55dBm

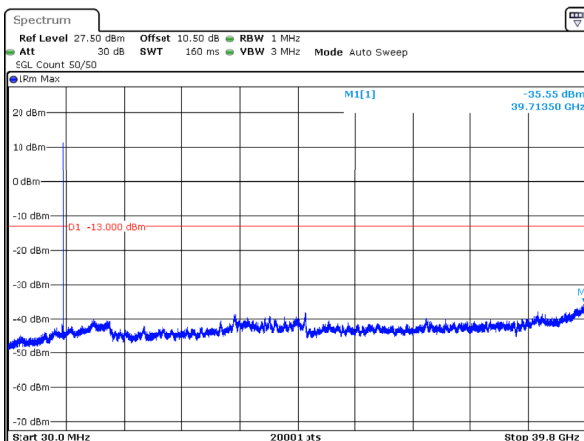


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:02:11

n77_3_100MHz_30kHz_3750MHz_DFT-s-OFDM
QPSK_RB270@0 -35.36dBm

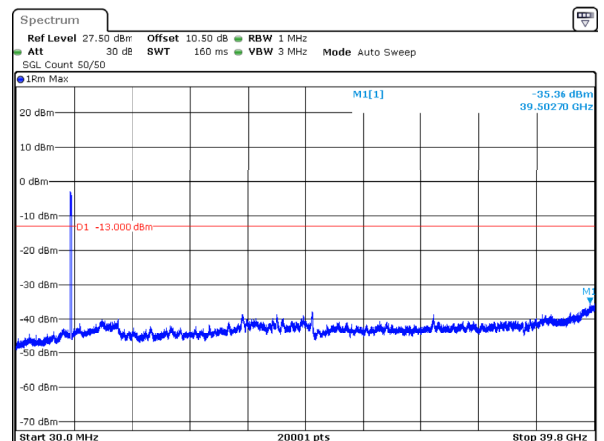


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:03:26

n77_3_100MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@0 -35.58dBm

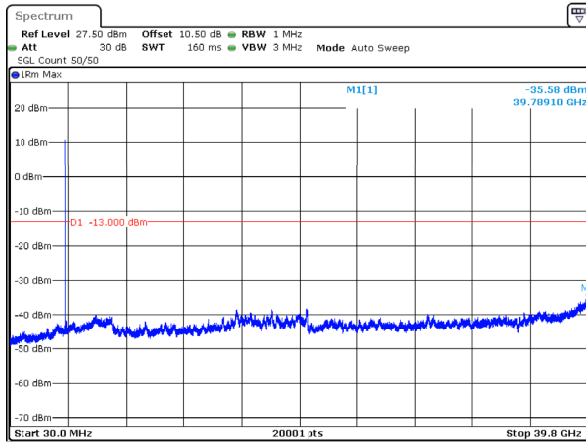


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:05:42

n77_3_100MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@272 -35.84dBm

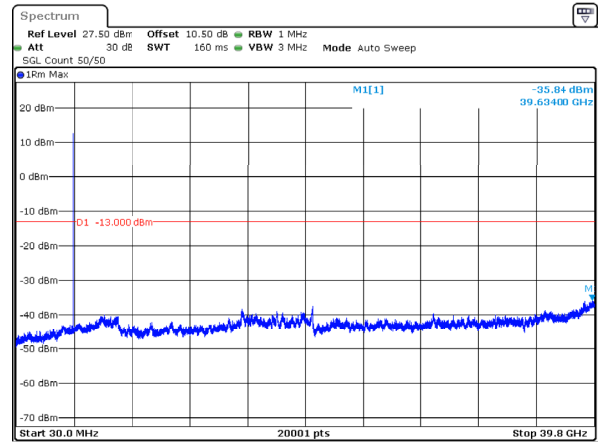


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:06:53

n77_3_100MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB270@0 -35.59dBm

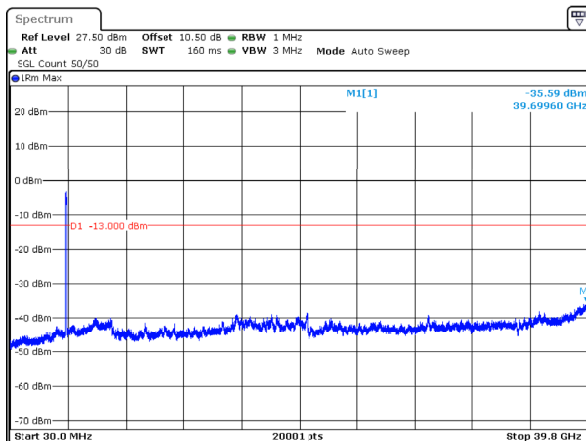


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:08:04

n77_3_100MHz_30kHz_3930MHz_DFT-s-OFDM
QPSK_RB1@0 -35.83dBm

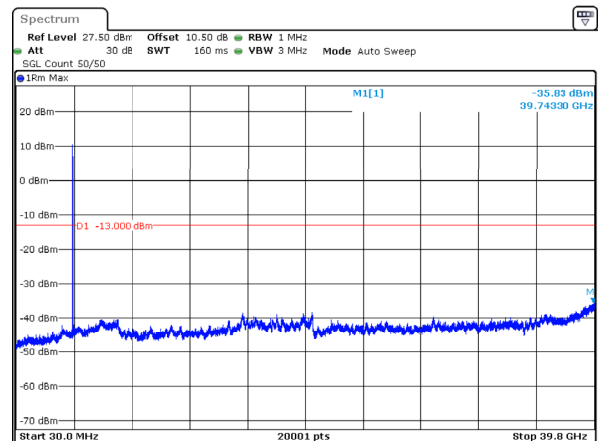


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:09:21

n77_3_100MHz_30kHz_3930MHz_DFT-s-OFDM
QPSK_RB1@272 -35.54dBm

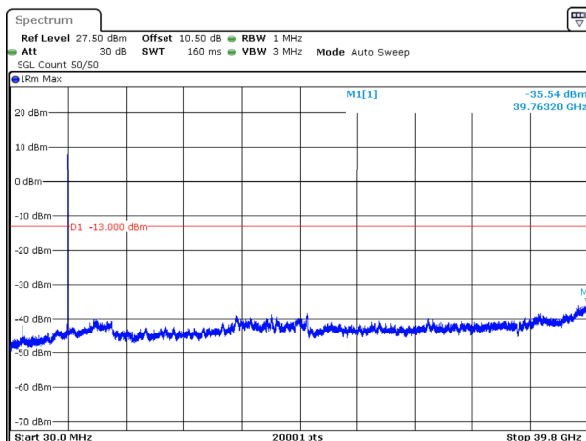

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:10:32


n77_3_100MHz_30kHz_3930MHz_DFT-s-OFDM
QPSK_RB270@0 -35.98dBm

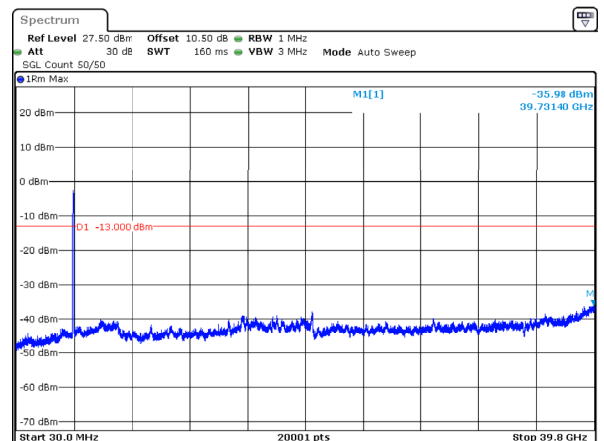

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:11:43


n78_1

n78_1_10MHz_30kHz_3455MHz_DFT-s-OFDM
QPSK_RB1@0 -37.50dBm

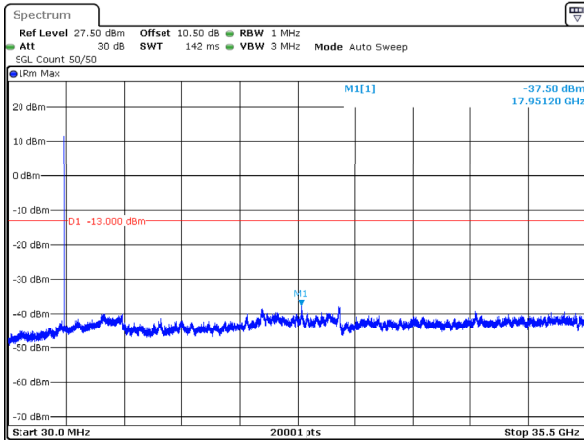


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:12:40

n78_1_10MHz_30kHz_3455MHz_DFT-s-OFDM
QPSK_RB1@23 -37.85dBm

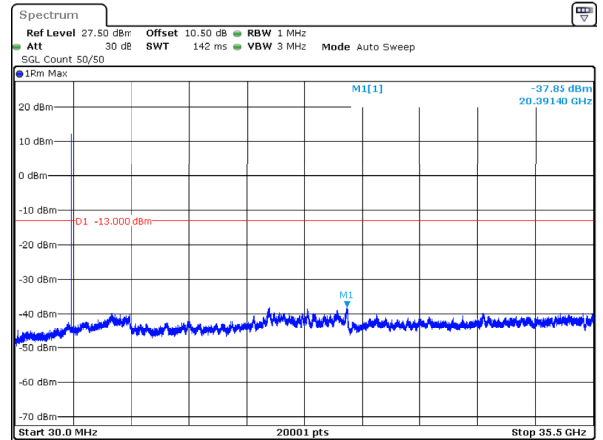


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:13:52

n78_1_10MHz_30kHz_3455MHz_DFT-s-OFDM
QPSK_RB24@0 -37.94dBm

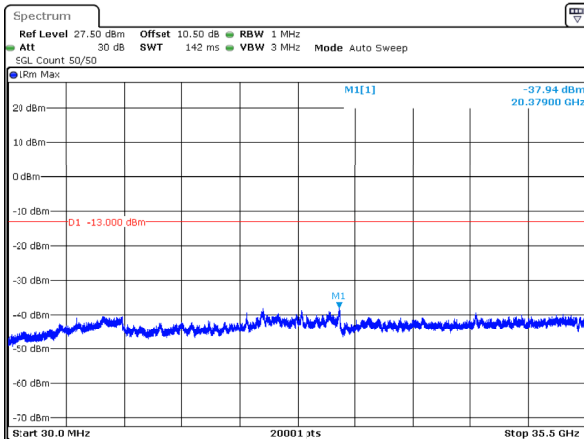


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:15:01

n78_1_10MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -37.80dBm

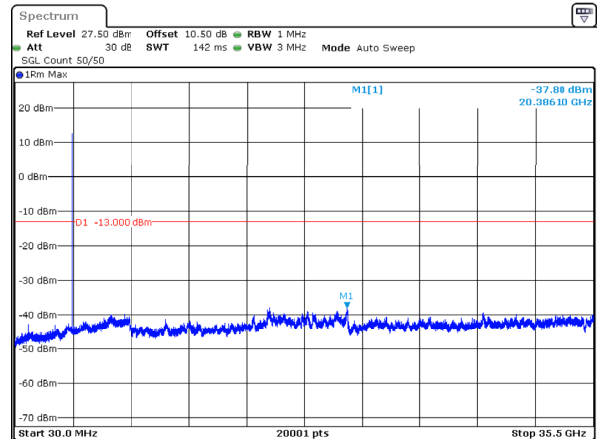


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:16:17

n78_1_10MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@23 -38.00dBm

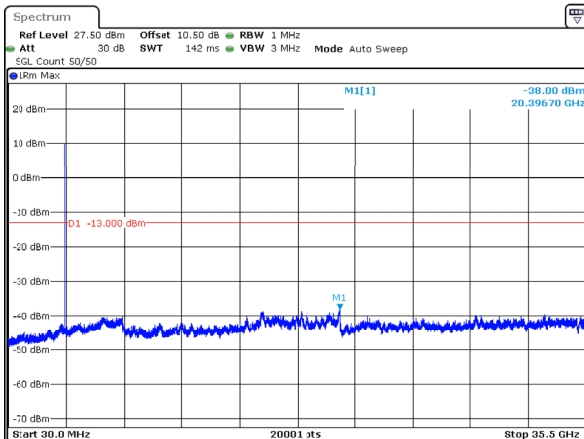


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:17:26

n78_1_10MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB24@0 -37.95dBm

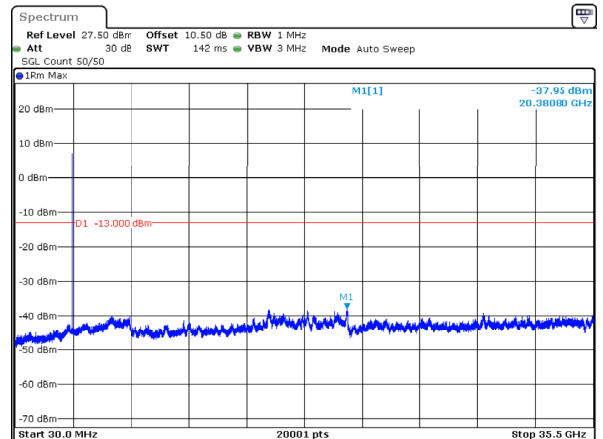


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:18:35


n78_1_10MHz_30kHz_3545MHz_DFT-s-OFDM
QPSK_RB1@0 -37.74dBm

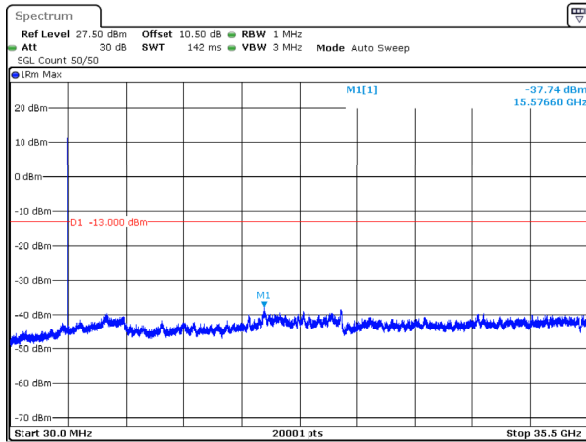


n78_1_10MHz_30kHz_3545MHz_DFT-s-OFDM
QPSK_RB1@23 -37.95dBm

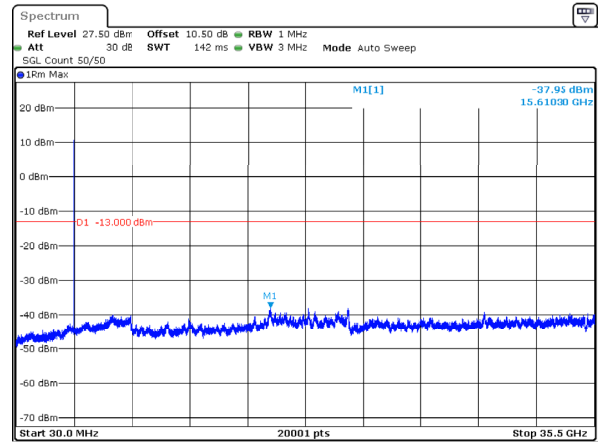


n78_1_10MHz_30kHz_3545MHz_DFT-s-OFDM
QPSK_RB24@0 -38.07dBm

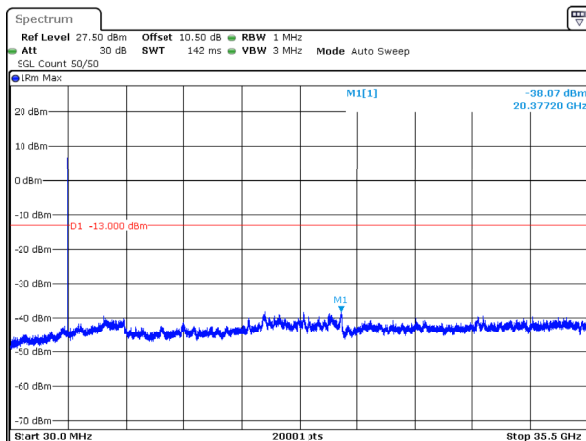


n78_1_15MHz_30kHz_3457.5MHz_DFT-s-OFDM
QPSK_RB1@0 -37.98dBm

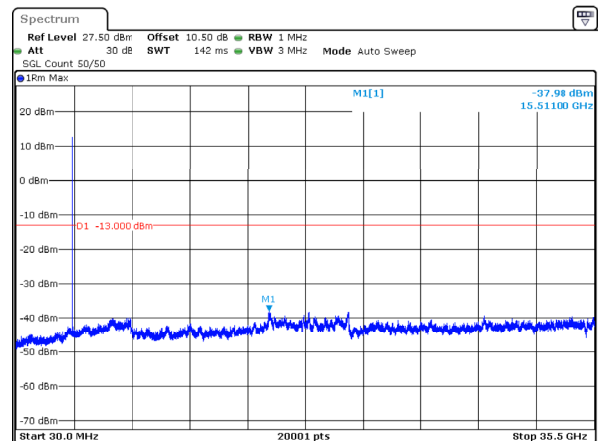


n78_1_15MHz_30kHz_3457.5MHz_DFT-s-OFDM
QPSK_RB1@37 -37.71dBm

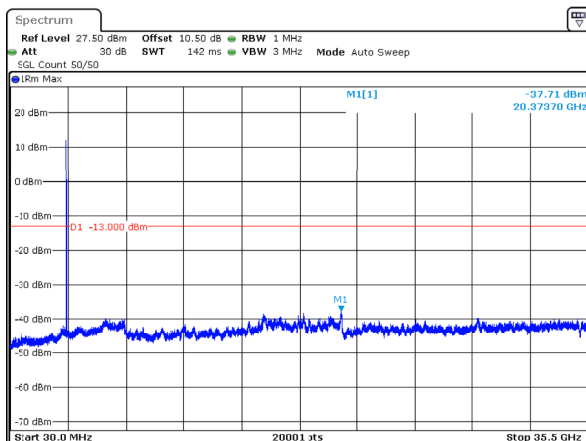

n78_1_15MHz_30kHz_3457.5MHz_DFT-s-OFDM
QPSK_RB36@0 -37.87dBm

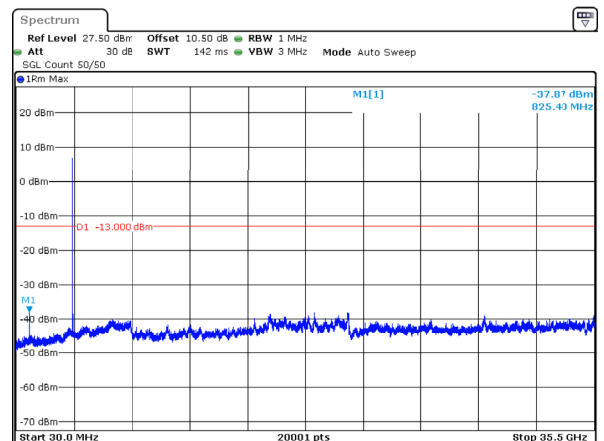


n78_1_15MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -38.14dBm

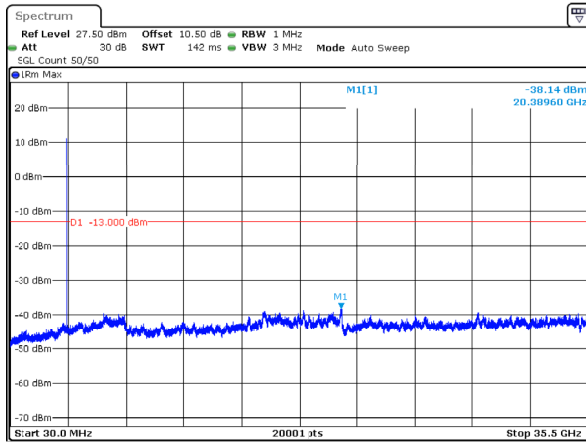


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:26:54

n78_1_15MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@37 -38.51dBm

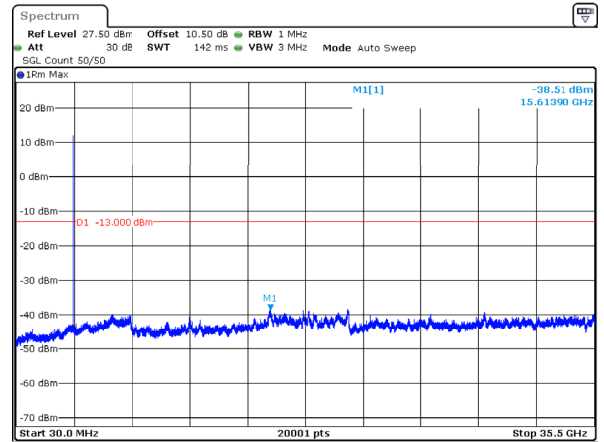


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:28:03

n78_1_15MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB36@0 -38.23dBm

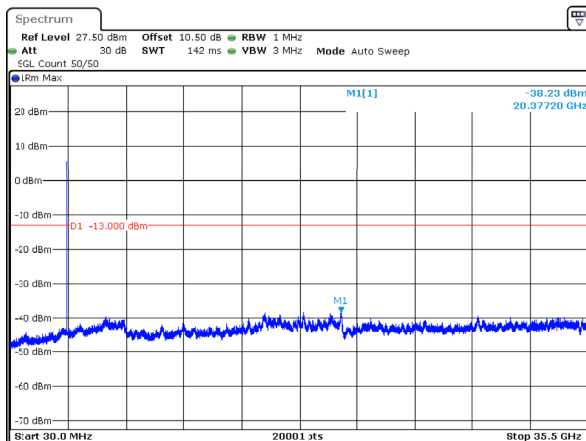


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:29:13

n78_1_15MHz_30kHz_3542.5MHz_DFT-s-OFDM
QPSK_RB1@0 -38.02dBm

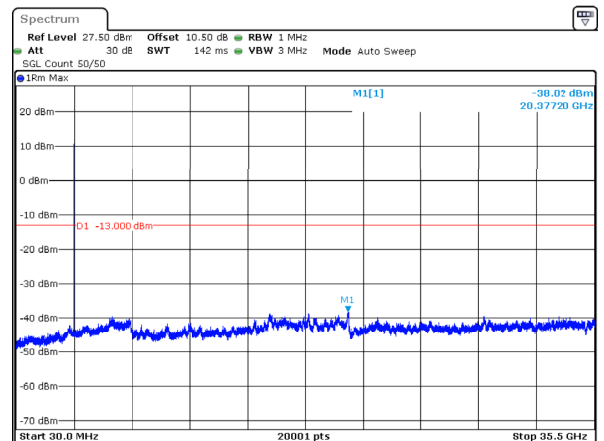


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:30:42

n78_1_15MHz_30kHz_3542.5MHz_DFT-s-OFDM
QPSK_RB1@37 -37.64dBm

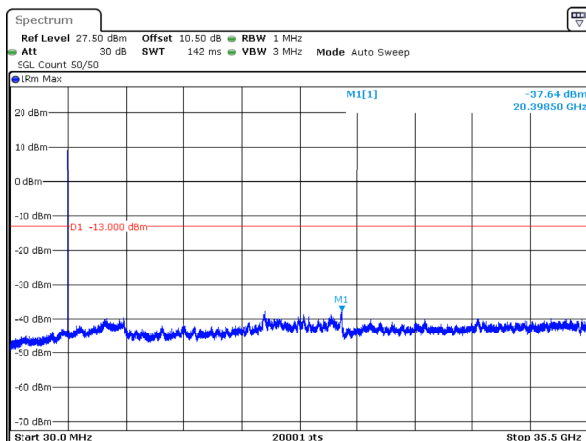


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:31:52

n78_1_15MHz_30kHz_3542.5MHz_DFT-s-OFDM
QPSK_RB36@0 -38.08dBm

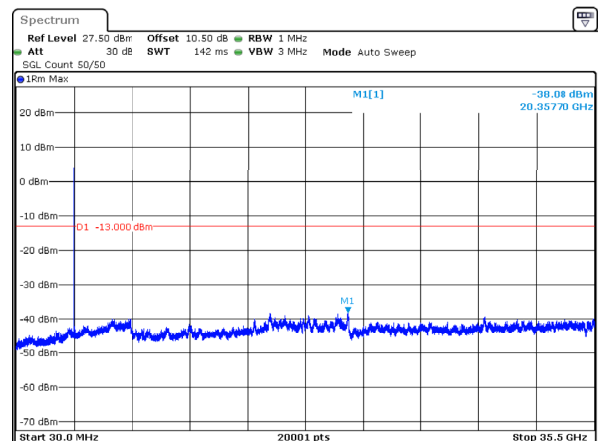


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:33:02

n78_1_20MHz_30kHz_3460MHz_DFT-s-OFDM
QPSK_RB1@0 -38.35dBm

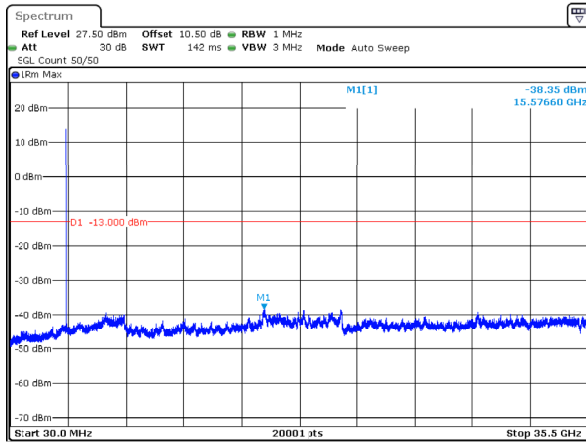


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:34:11

n78_1_20MHz_30kHz_3460MHz_DFT-s-OFDM
QPSK_RB1@50 -37.98dBm

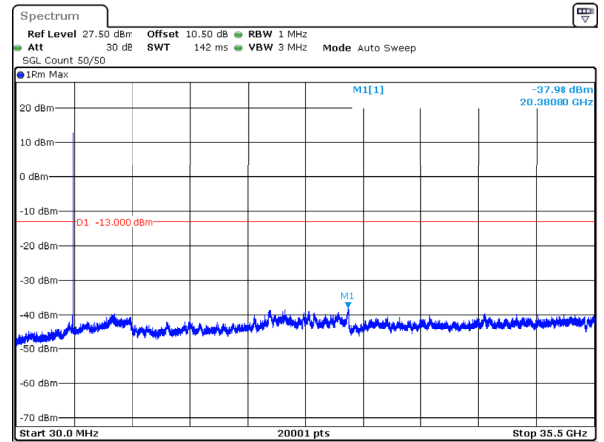


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:35:20

n78_1_20MHz_30kHz_3460MHz_DFT-s-OFDM
QPSK_RB50@0 -37.68dBm

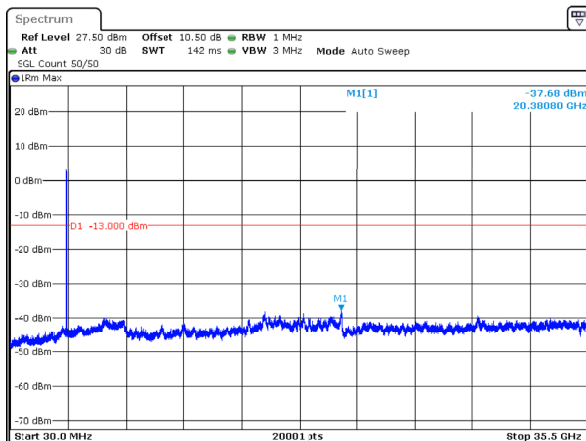


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:36:30

n78_1_20MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -37.95dBm

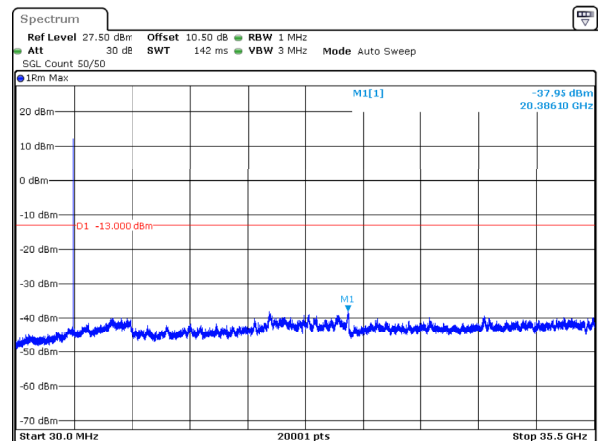


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:37:46

n78_1_20MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@50 -37.68dBm

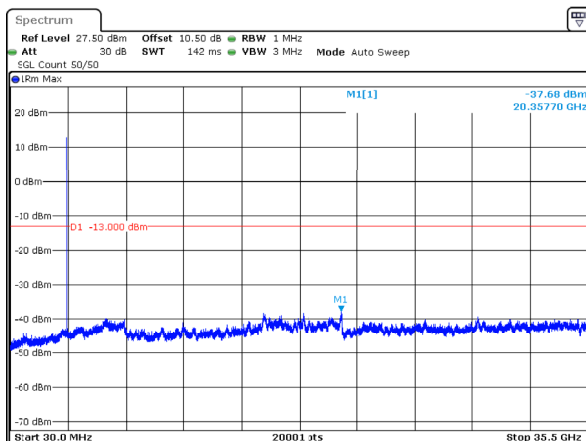


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:38:55

n78_1_20MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB50@0 -37.32dBm

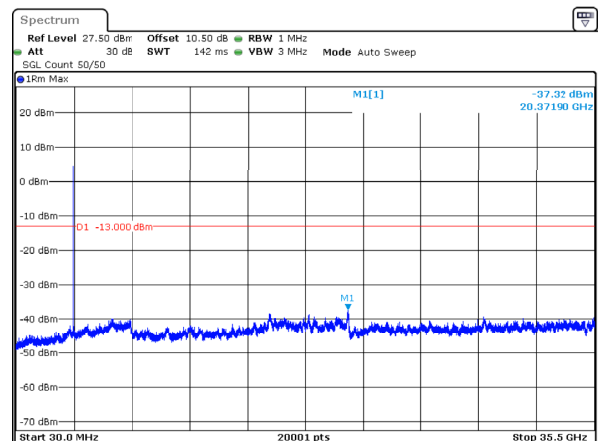


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:40:05

n78_1_20MHz_30kHz_3540MHz_DFT-s-OFDM
QPSK_RB1@0 -37.36dBm

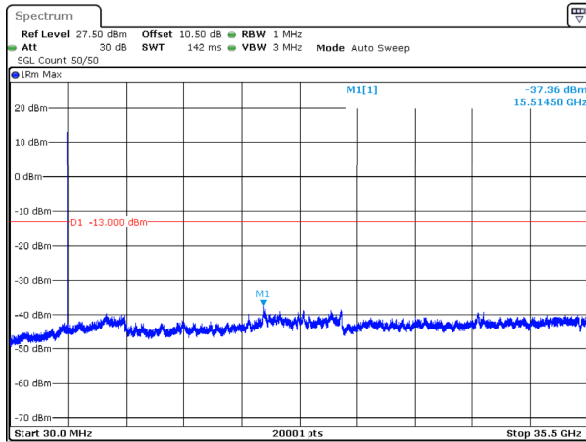


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:41:21

n78_1_20MHz_30kHz_3540MHz_DFT-s-OFDM
QPSK_RB1@50 -38.08dBm

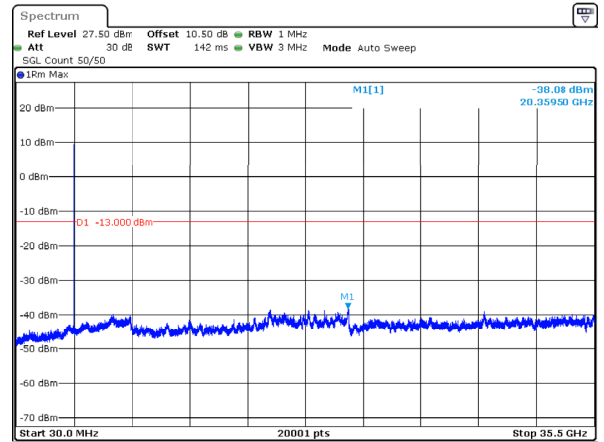


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:42:30

n78_1_20MHz_30kHz_3540MHz_DFT-s-OFDM
QPSK_RB50@0 -38.07dBm

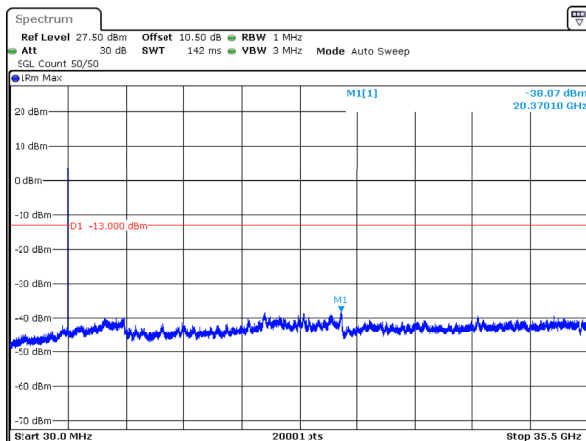


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:43:40

n78_1_30MHz_30kHz_3465MHz_DFT-s-OFDM
QPSK_RB1@0 -37.48dBm

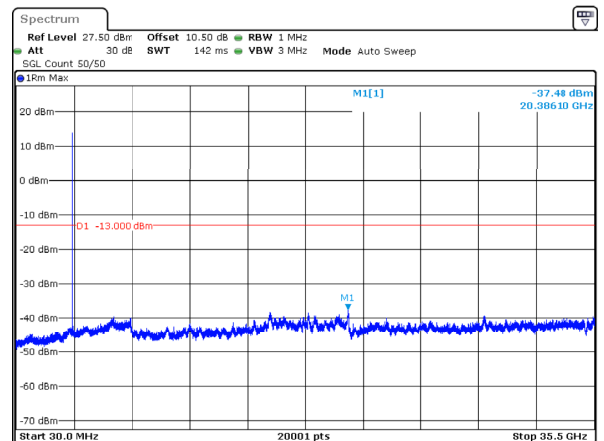


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:44:50

n78_1_30MHz_30kHz_3465MHz_DFT-s-OFDM
QPSK_RB1@77 -37.71dBm

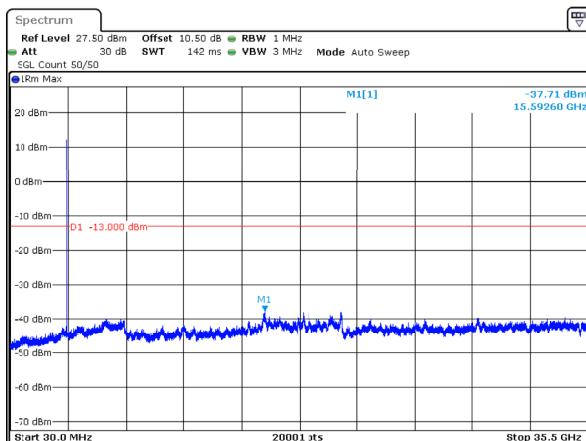


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:45:47

n78_1_30MHz_30kHz_3465MHz_DFT-s-OFDM
QPSK_RB75@0 -37.92dBm

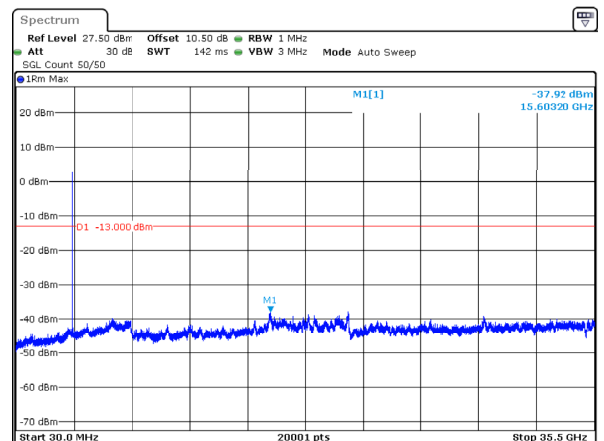


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:46:57

n78_1_30MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -37.87dBm

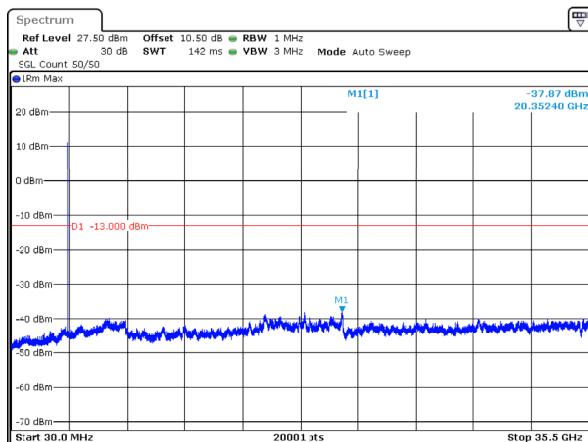


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:48:15

n78_1_30MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@77 -37.52dBm

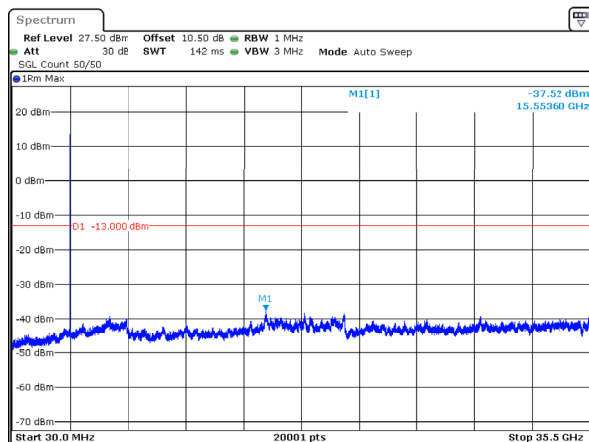


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:49:25

n78_1_30MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB75@0 -37.45dBm

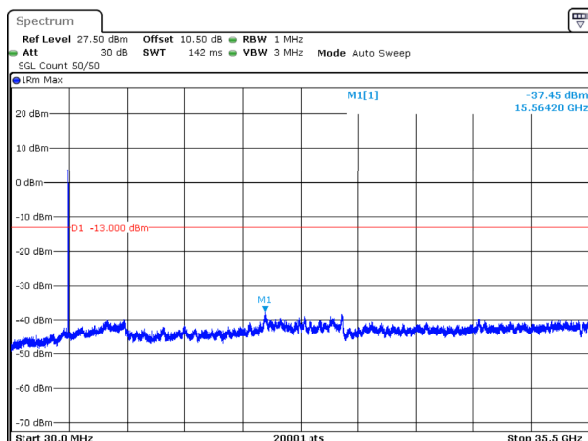


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:50:35

n78_1_30MHz_30kHz_3535MHz_DFT-s-OFDM
QPSK_RB1@0 -38.12dBm

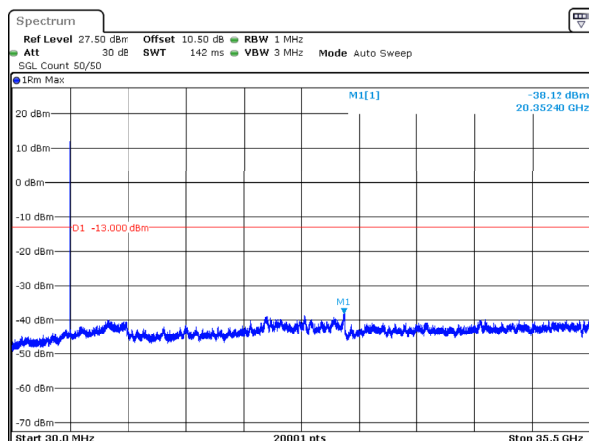


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:51:50

n78_1_30MHz_30kHz_3535MHz_DFT-s-OFDM
QPSK_RB1@77 -38.22dBm

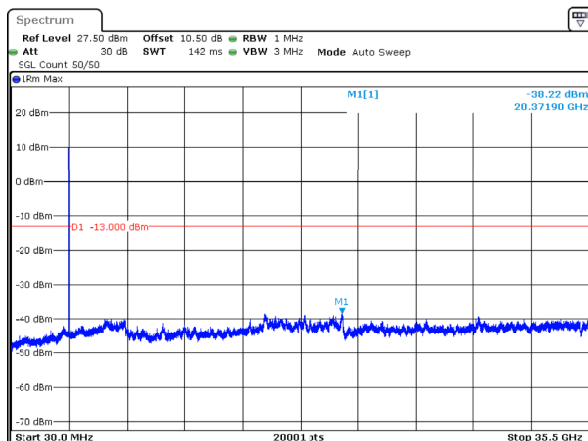


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:53:04

n78_1_30MHz_30kHz_3535MHz_DFT-s-OFDM
QPSK_RB75@0 -37.38dBm

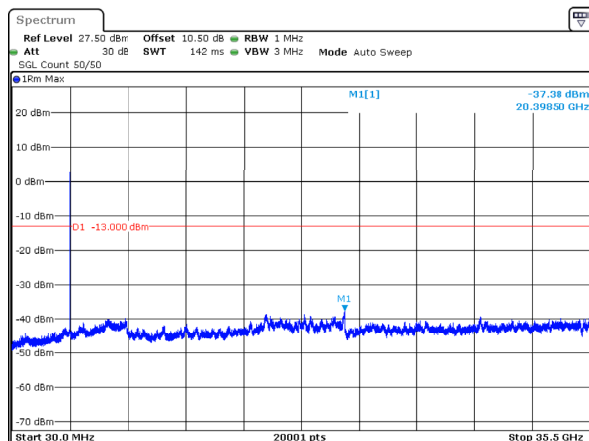


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:54:14

n78_1_40MHz_30kHz_3470MHz_DFT-s-OFDM
QPSK_RB100@0 -38.51dBm

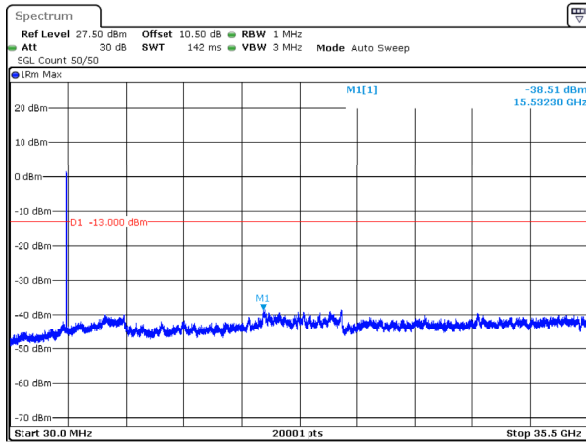


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:57:43

n78_1_40MHz_30kHz_3470MHz_DFT-s-OFDM
QPSK_RB1@0 -37.73dBm

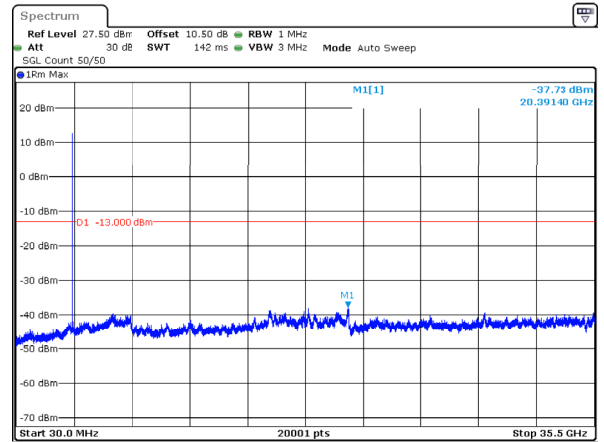


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:55:23

n78_1_40MHz_30kHz_3470MHz_DFT-s-OFDM
QPSK_RB1@105 -38.08dBm

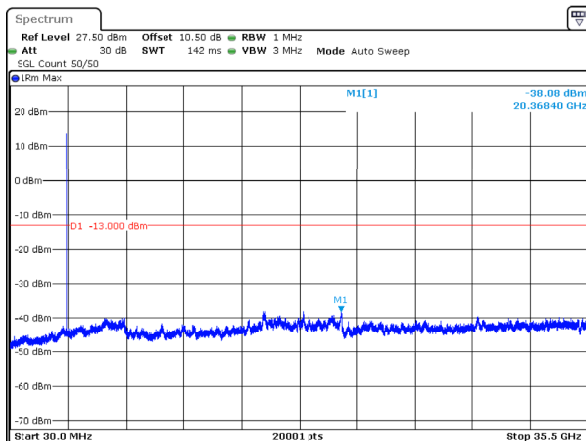


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:56:33

n78_1_40MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB100@0 -38.04dBm

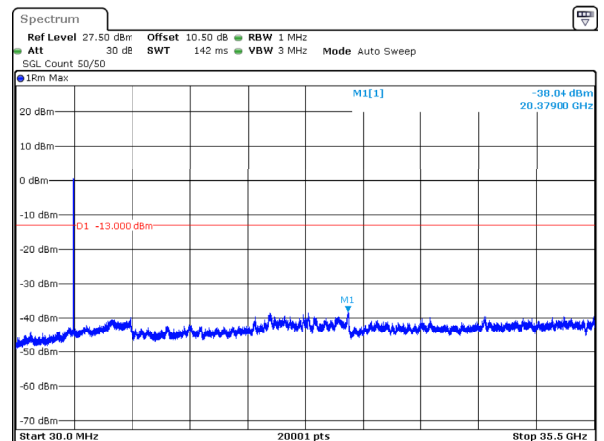


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:01:19

n78_1_40MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -38.07dBm

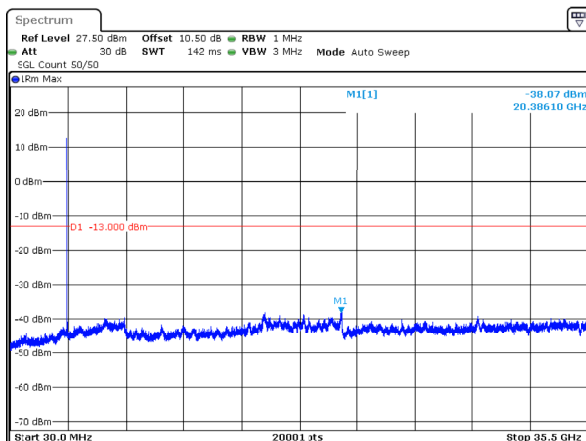


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 19:58:59

n78_1_40MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@105 -38.19dBm

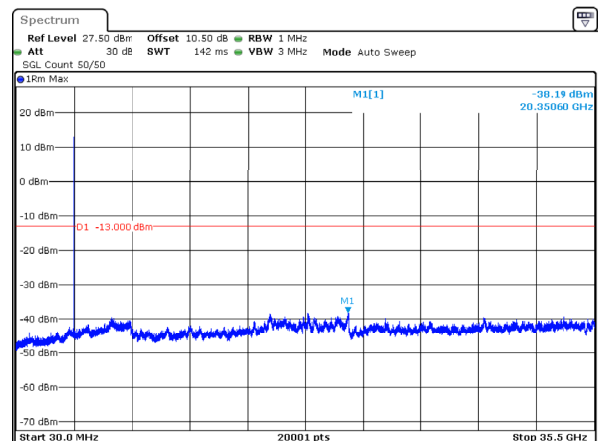


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:00:09

n78_1_40MHz_30kHz_3530MHz_DFT-s-OFDM
QPSK_RB100@0 -37.92dBm

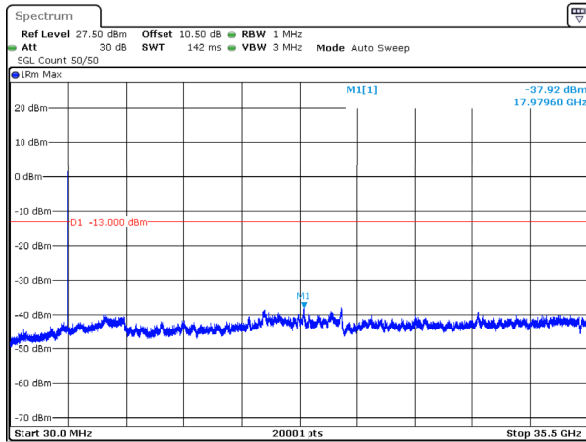


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:04:42

n78_1_40MHz_30kHz_3530MHz_DFT-s-OFDM
QPSK_RB1@0 -38.29dBm

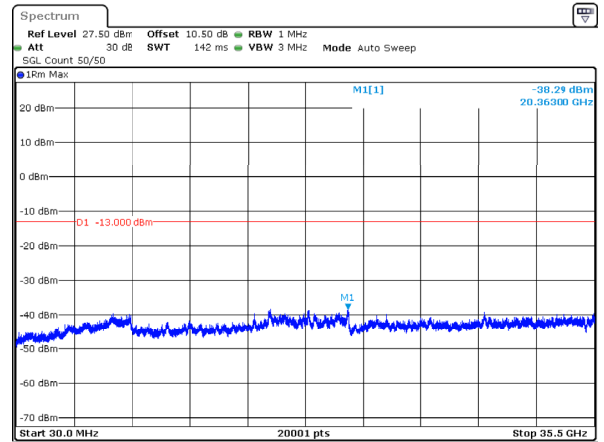


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:02:34

n78_1_40MHz_30kHz_3530MHz_DFT-s-OFDM
QPSK_RB1@105 -37.82dBm

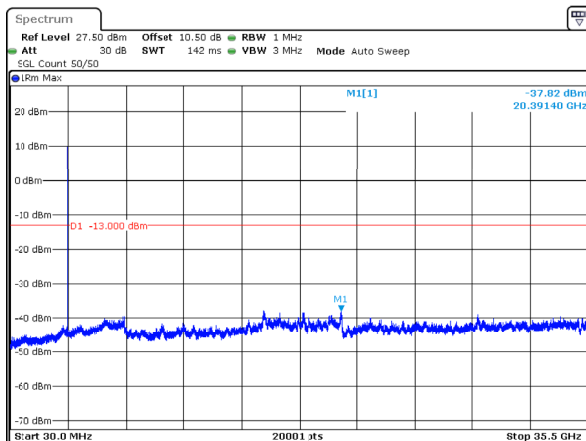


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:03:33

n78_1_50MHz_30kHz_3475MHz_DFT-s-OFDM
QPSK_RB128@0 -37.87dBm

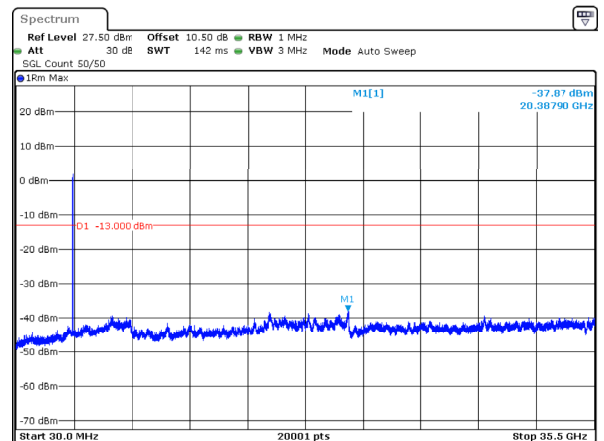


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:08:12

n78_1_50MHz_30kHz_3475MHz_DFT-s-OFDM
QPSK_RB1@0 -37.70dBm

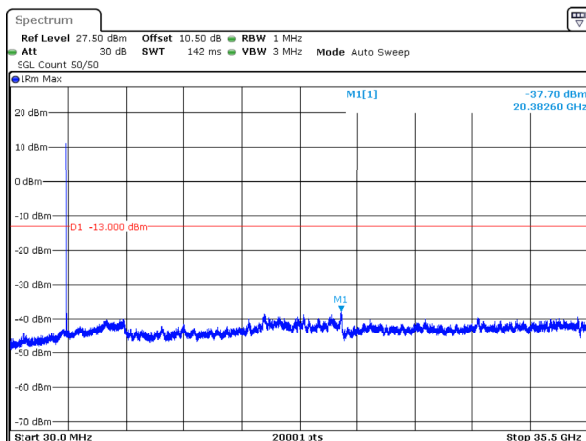


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:05:52

n78_1_50MHz_30kHz_3475MHz_DFT-s-OFDM
QPSK_RB1@132 -37.28dBm

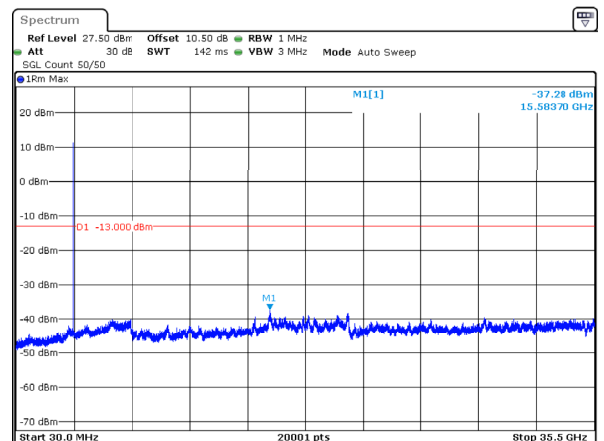


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:07:02

n78_1_50MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB128@0 -37.87dBm

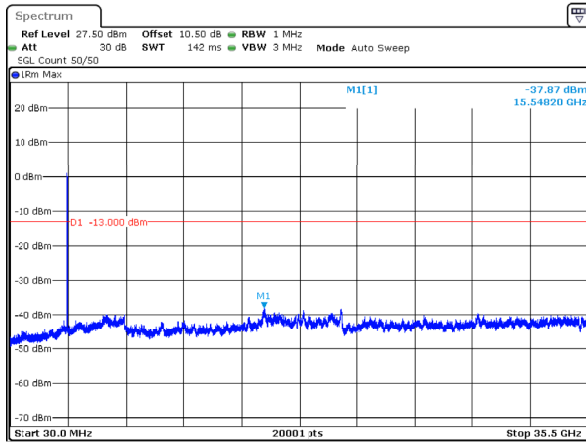


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:11:52

n78_1_50MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -37.46dBm

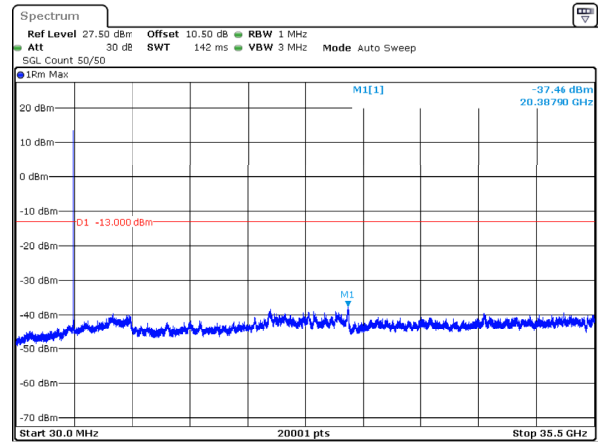


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:09:28

n78_1_50MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@132 -37.95dBm

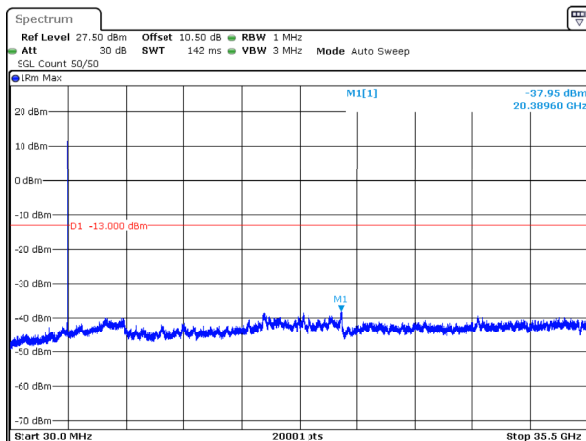


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:10:38

n78_1_50MHz_30kHz_3525MHz_DFT-s-OFDM
QPSK_RB128@0 -37.63dBm

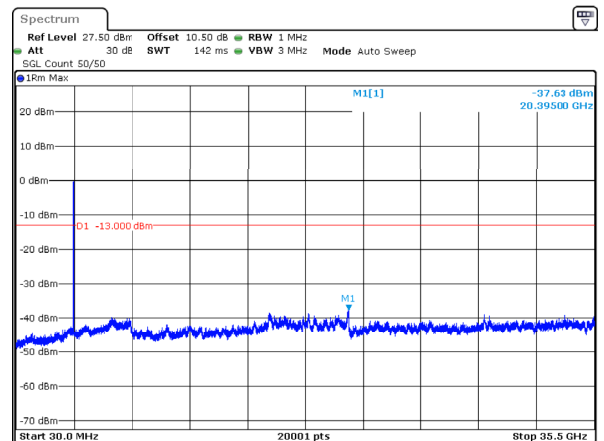


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:15:28

n78_1_50MHz_30kHz_3525MHz_DFT-s-OFDM
QPSK_RB1@0 -37.62dBm

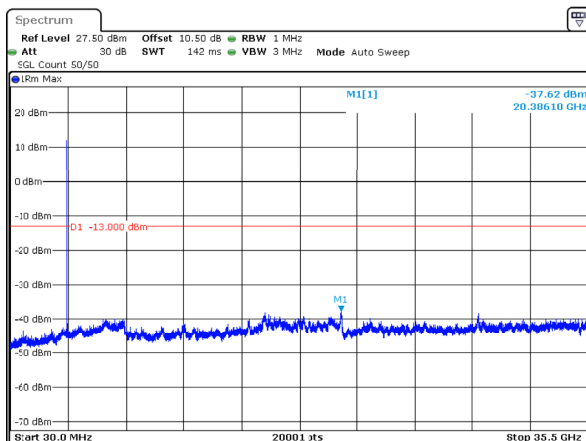

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:13:08

n78_1_50MHz_30kHz_3525MHz_DFT-s-OFDM
QPSK_RB1@132 -37.95dBm

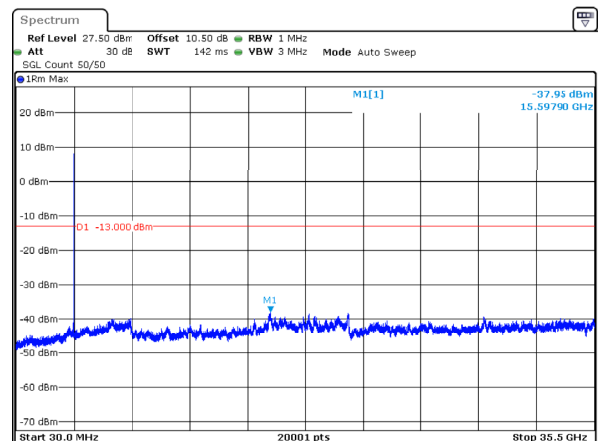

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 20:14:18