




n77_3_50MHz_30kHz_3840MHz_DFT-s-OFDM $\pi/2$
BPSK_RB128@0 46.898MHz

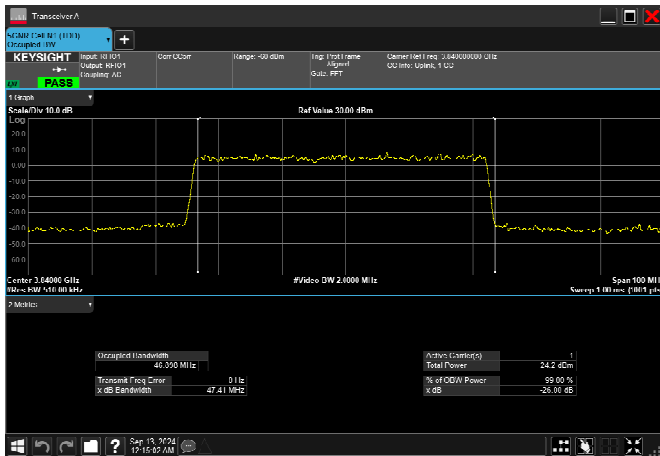


n77_3_50MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB128@0 46.665MHz

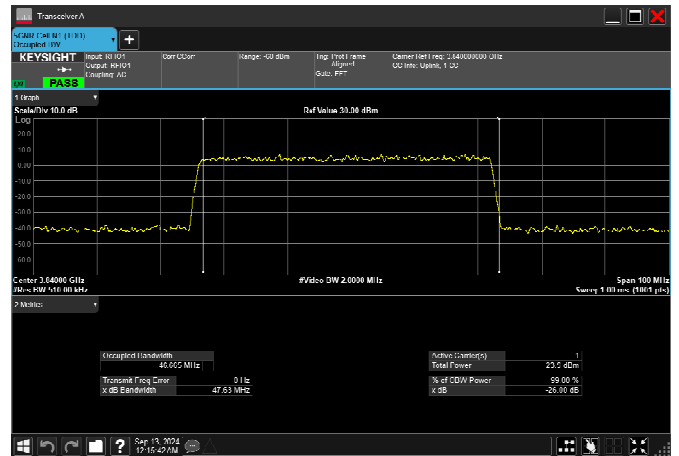


n77_3_50MHz_30kHz_3840MHz_DFT-s-OFDM 16
QAM_RB128@0 47.005MHz

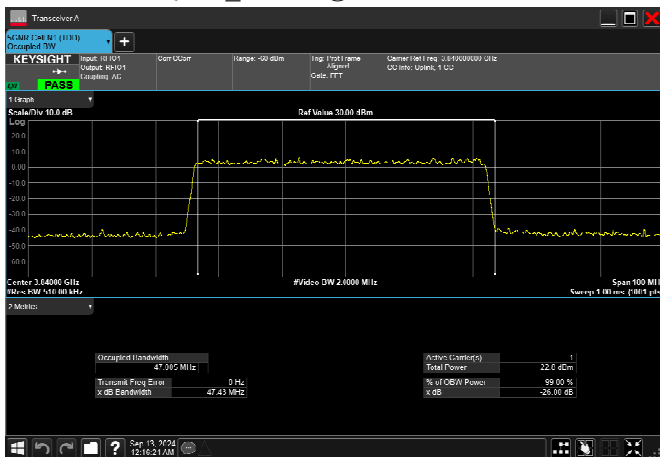


n77_3_50MHz_30kHz_3840MHz_DFT-s-OFDM 64
QAM_RB128@0 46.868MHz

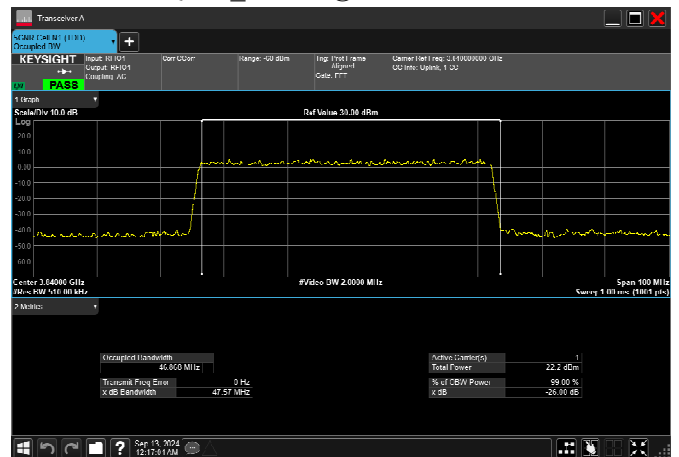


n77_3_50MHz_30kHz_3840MHz_DFT-s-OFDM 256
QAM_RB128@0 47.070MHz

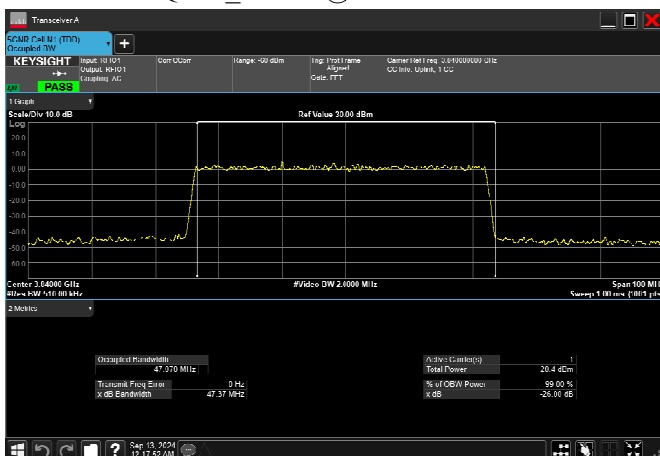


n77_3_50MHz_30kHz_3840MHz_CP-OFDM
QPSK_RB133@0 47.444MHz

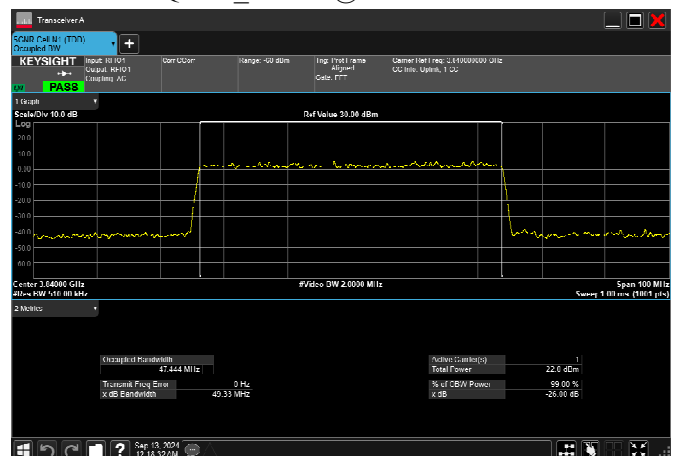


n77_3_50MHz_30kHz_3840MHz_CP-OFDM 64
QAM RB133@0 47.472MHz

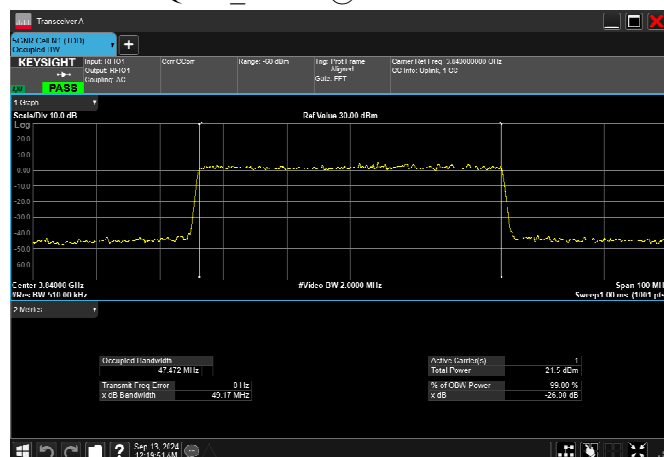

n77_3_50MHz_30kHz_3955MHz_DFT-s-OFDM $\pi/2$
BPSK RB128@0 46.878MHz

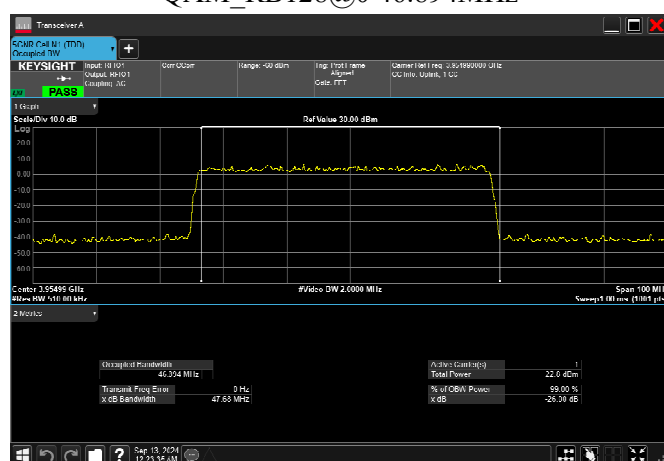n77_3_50MHz_30kHz_3955MHz_DFT-s-OFDM 16
OAM RB128@0 46.894MHz


n77_3_50MHz_30kHz_3955MHz_DFT-s-OFDM 256
QAM RB128@0 47.099MHz

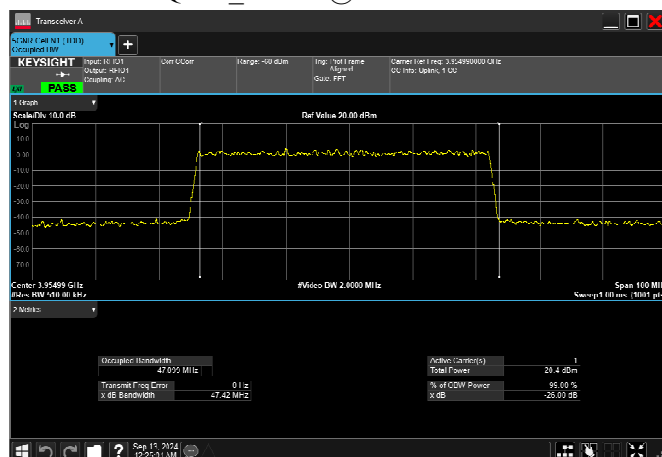


n77_3_50MHz_30kHz_3955MHz_CP-OFDM 16
QAM RB133@0 47.436MHz




n77_3_50MHz_30kHz_3955MHz_CP-OFDM 256
QAM RB133@0 47.292MHz

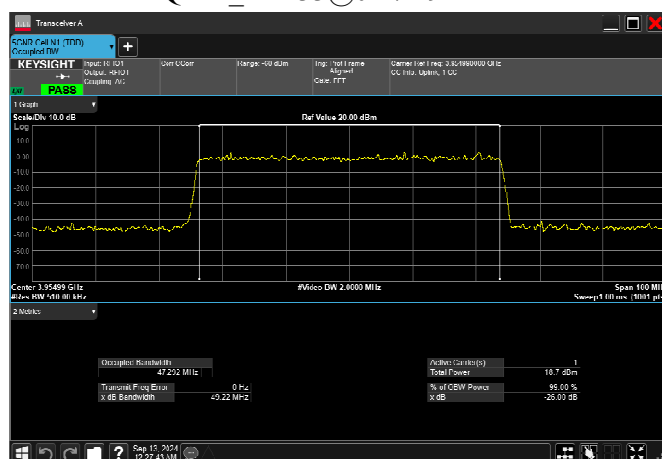


n77_3_60MHz_30kHz_3730MHz_DFT-s-OFDM
QPSK RB162@0 57.716MHz

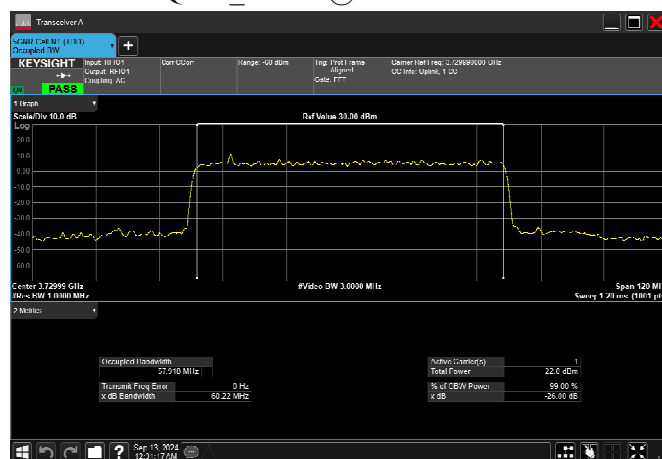n77_3_60MHz_30kHz_3730MHz_DFT-s-OFDM 64
OAM RB162@0 57.918MHz


n77_3_60MHz_30kHz_3730MHz_CP-OFDM
OPSK RB162@0 57.643MHz

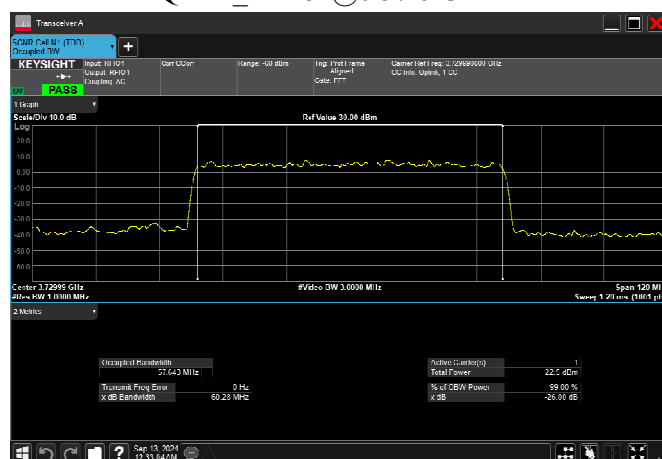


n77_3_60MHz_30kHz_3730MHz_CP-OFDM 16
QAM_RB162@0 57.676MHz

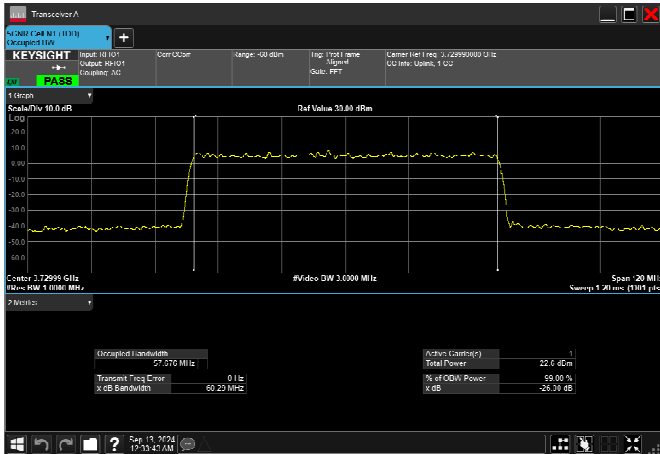


n77_3_60MHz_30kHz_3730MHz_CP-OFDM 64
QAM_RB162@0 57.847MHz

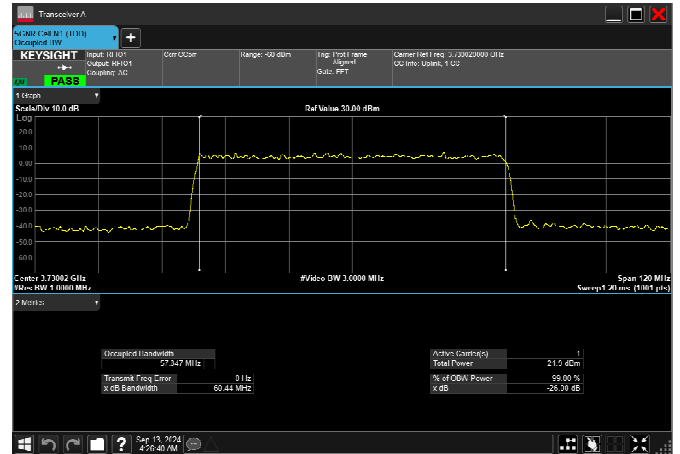


n77_3_60MHz_30kHz_3730MHz_CP-OFDM 256
QAM_RB162@0 57.619MHz

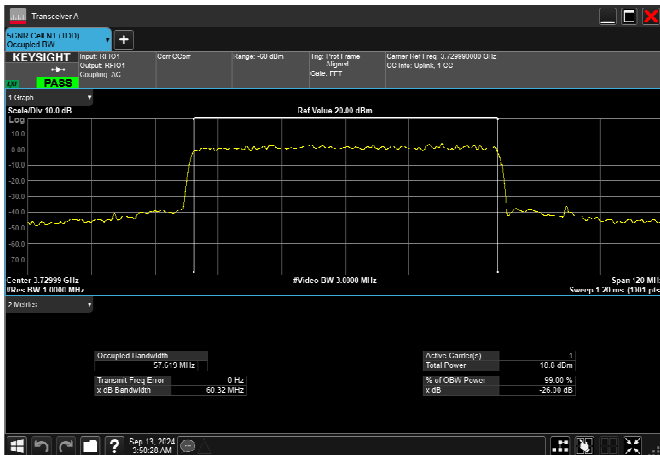


n77_3_60MHz_30kHz_3840MHz_DFT-s-OFDM $\pi/2$
BPSK_RB162@0 57.879MHz

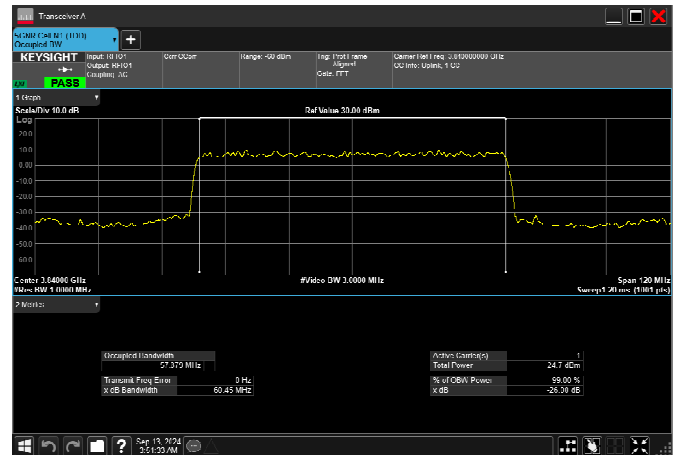



n77_3_60MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB162@0 57.717MHz

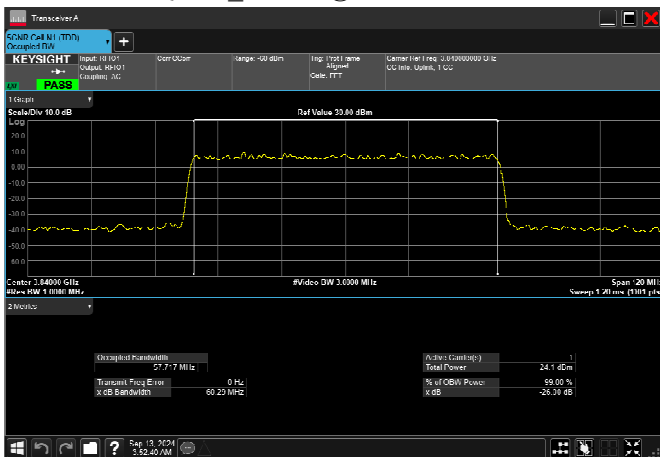

n77_3_60MHz_30kHz_3840MHz_DFT-s-OFDM 16
QAM_RB162@0 57.855MHz

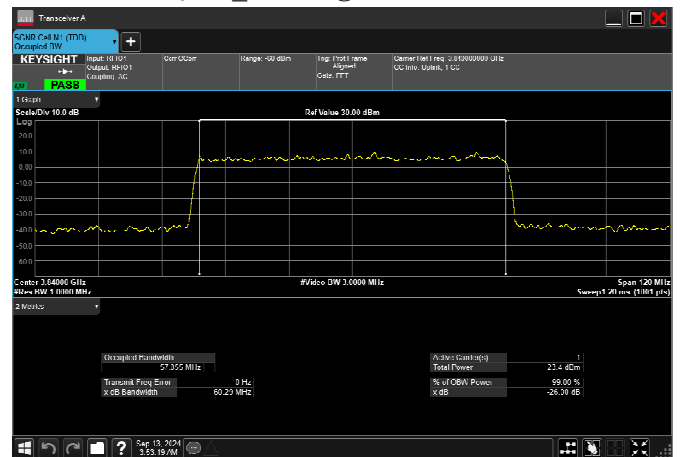

n77_3_60MHz_30kHz_3840MHz_DFT-s-OFDM 256
QAM RB162@0 57.622MHz

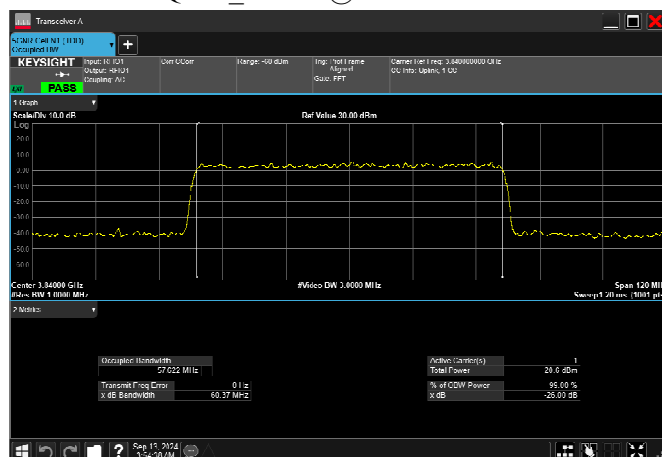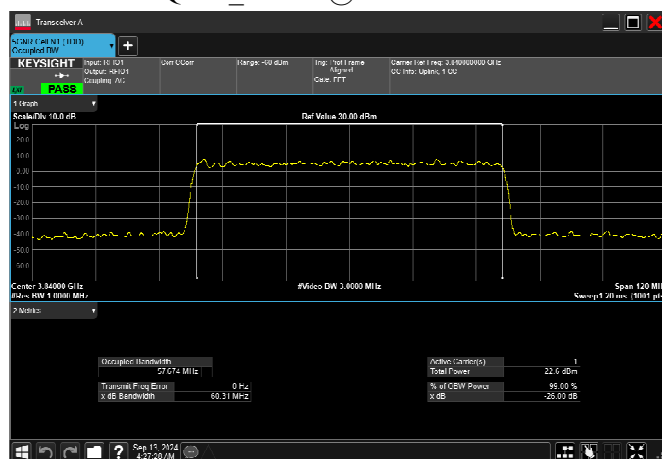n77_3_60MHz_30kHz_3840MHz_CP-OFDM 16
OAM RB162@0 57.674MHzn77_3_60MHz_30kHz_3840MHz_CP-OFDM 256
OAM RB162@0 57.651MHz