



n77_3_100MHz_30kHz_3930MHz_DFT-s-OFDM
QPSK_RB1@272 -0.169MHz

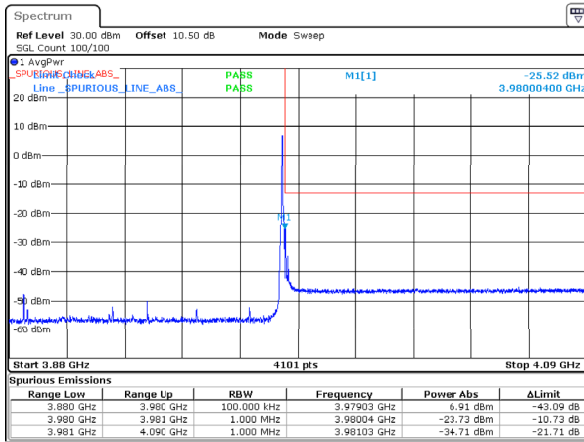


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 16.JUL.2024 19:21:25

n77_3_100MHz_30kHz_3930MHz_DFT-s-OFDM
QPSK_RB270@0 -45.474MHz

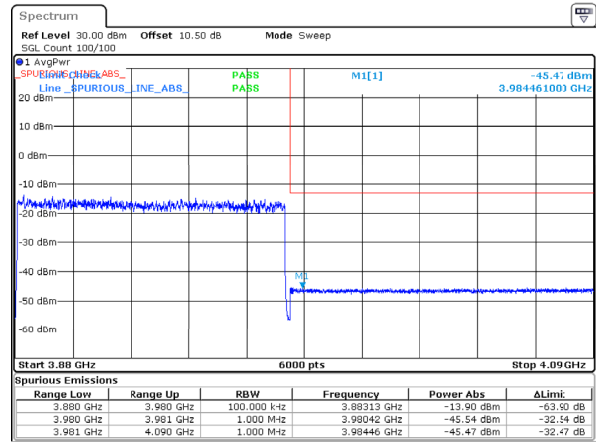


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 16.JUL.2024 19:22:56

n78_1
n78_1_10MHz_30kHz_3455MHz_DFT-s-OFDM
QPSK_RB1@0 -31.449MHz

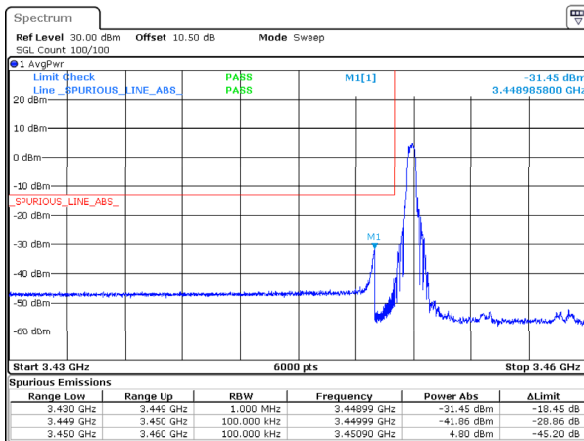


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 15:57:29

n78_1_10MHz_30kHz_3455MHz_DFT-s-OFDM
QPSK_RB24@0 -45.592MHz

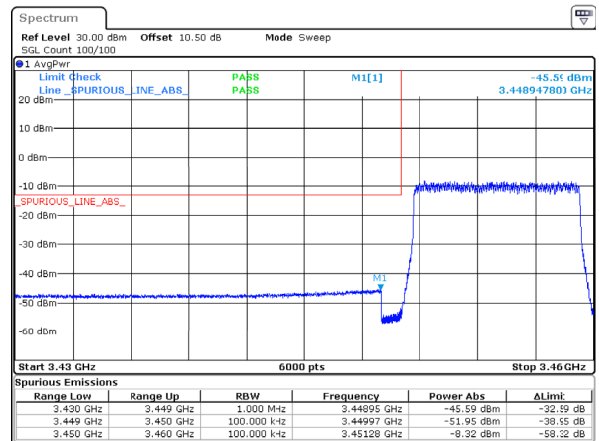


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 15:58:16

n78_1_10MHz_30kHz_3545MHz_DFT-s-OFDM
QPSK_RB1@23 -44.034MHz

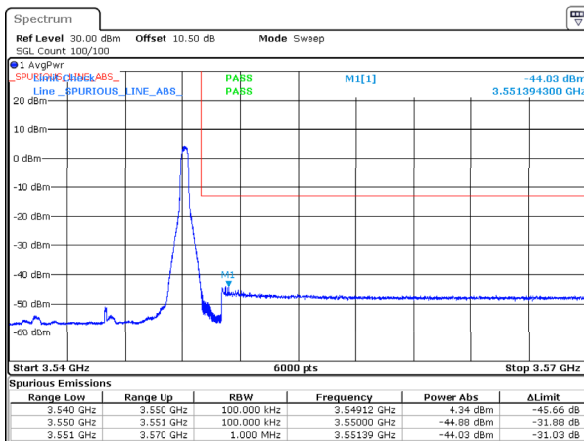


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 15:59:08

n78_1_10MHz_30kHz_3545MHz_DFT-s-OFDM
QPSK_RB24@0 -45.368MHz

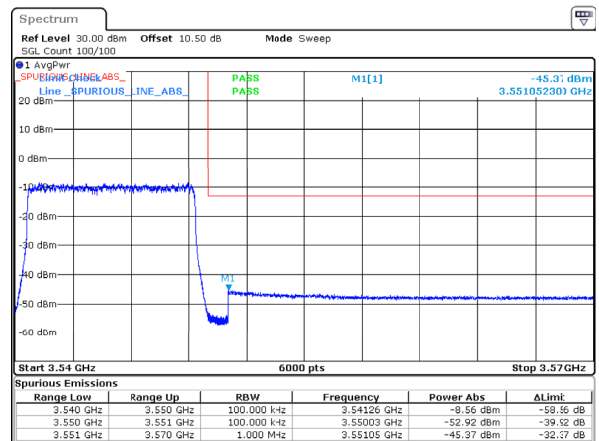


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 15:59:55

n78_1_15MHz_30kHz_3457.5MHz_DFT-s-OFDM
QPSK_RB1@0 -37.119MHz

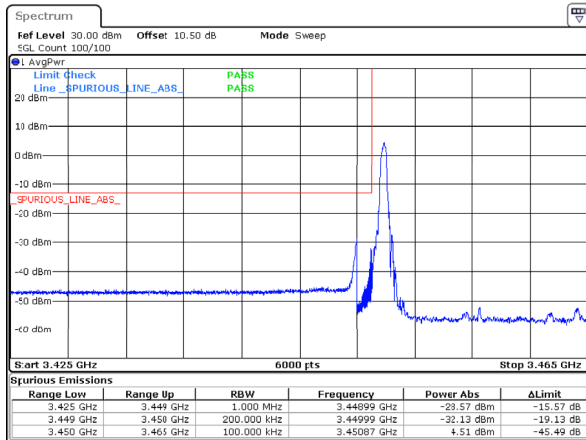


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:01:54

n78_1_15MHz_30kHz_3457.5MHz_DFT-s-OFDM
QPSK_RB36@0 -46.305MHz

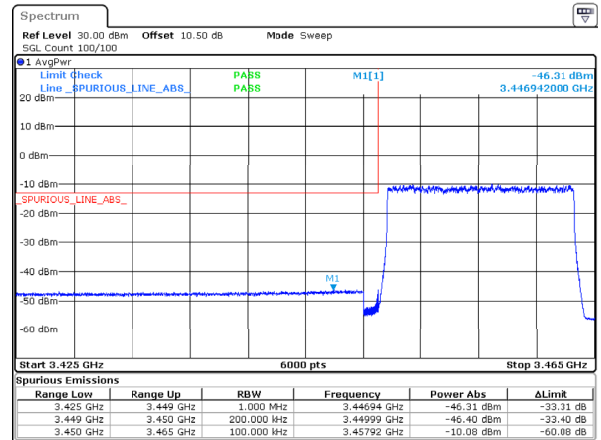


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:28:13

n78_1_15MHz_30kHz_3542.5MHz_DFT-s-OFDM
QPSK_RB1@37 -37.308MHz

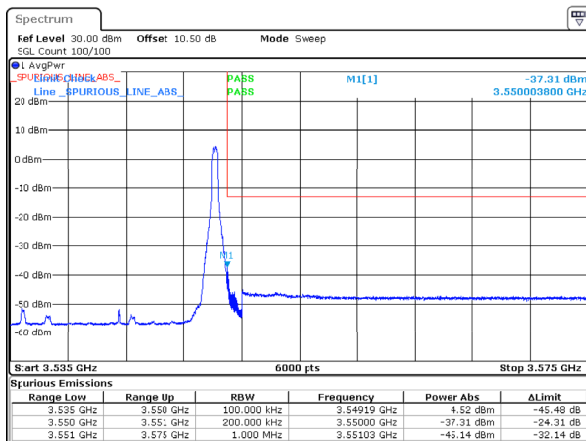


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:29:14

n78_1_15MHz_30kHz_3542.5MHz_DFT-s-OFDM
QPSK_RB36@0 -46.081MHz

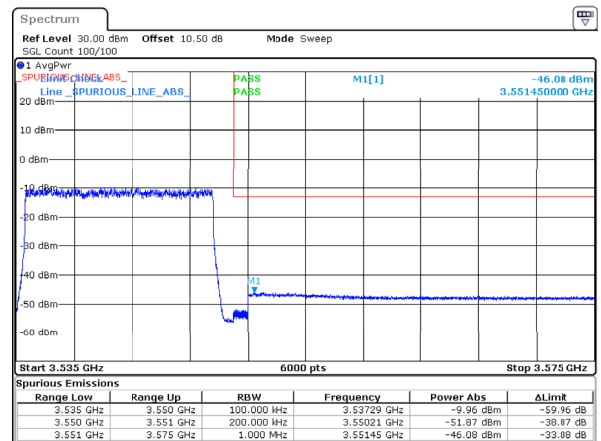


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:30:10

n78_1_20MHz_30kHz_3460MHz_DFT-s-OFDM
QPSK_RB1@0 -43.453MHz

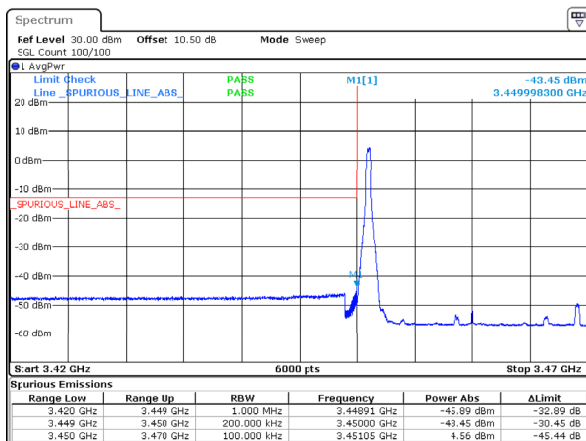


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:31:25

n78_1_20MHz_30kHz_3460MHz_DFT-s-OFDM
QPSK_RB50@0 -46.169MHz

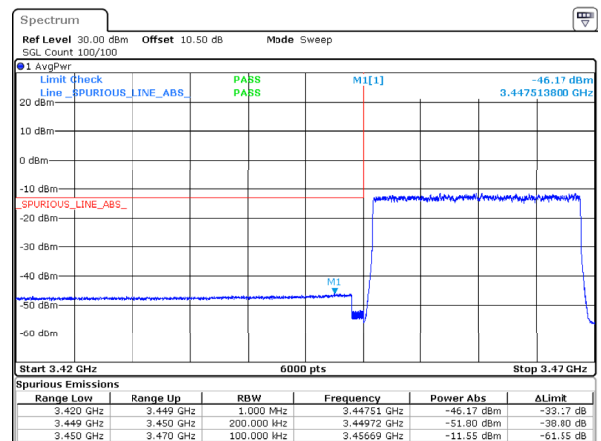


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:36:46

n78_1_20MHz_30kHz_3540MHz_DFT-s-OFDM
QPSK_RB1@50 -45.715MHz

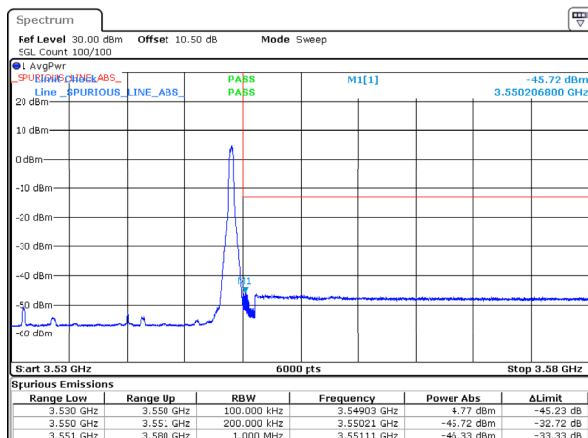


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:37:58

n78_1_20MHz_30kHz_3540MHz_DFT-s-OFDM
QPSK_RB50@0 -45.745MHz

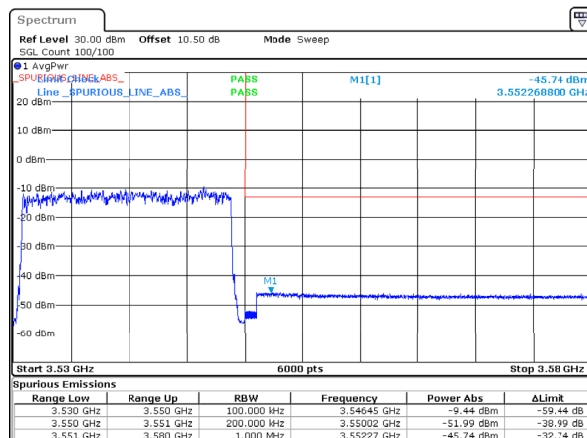


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:17:49

n78_1_30MHz_30kHz_3465MHz_DFT-s-OFDM
QPSK_RB1@0 -32.942MHz

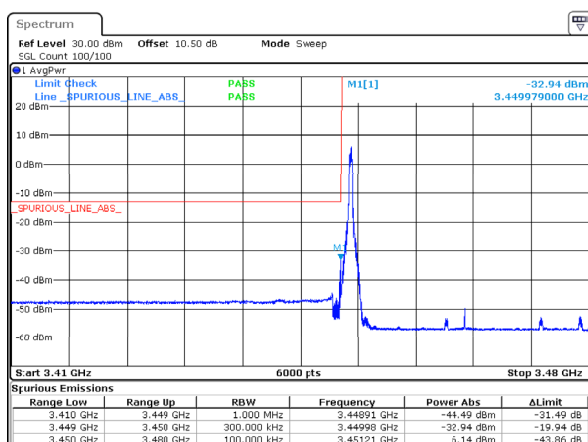


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:41:57

n78_1_30MHz_30kHz_3465MHz_DFT-s-OFDM
QPSK_RB75@0 -46.354MHz

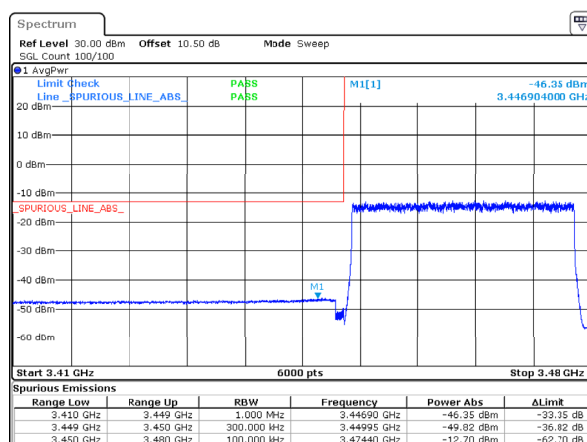


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:43:27

n78_1_30MHz_30kHz_3535MHz_DFT-s-OFDM
QPSK_RB1@77 -34.667MHz

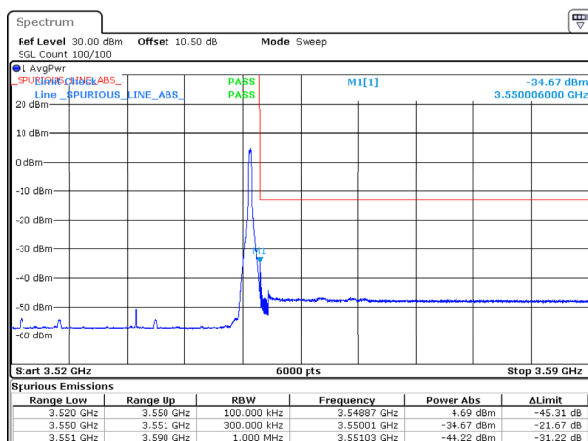


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:45:02

n78_1_30MHz_30kHz_3535MHz_DFT-s-OFDM
QPSK_RB75@0 -46.839MHz

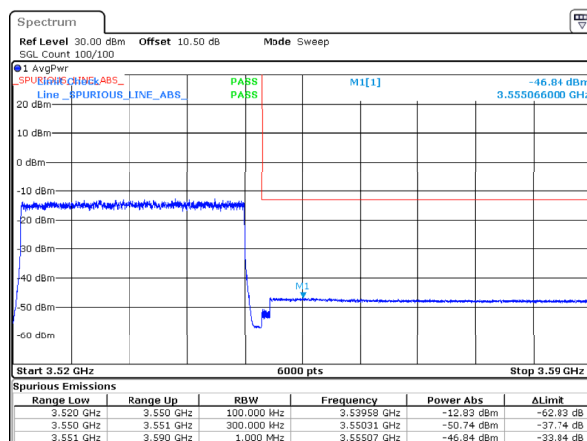


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:46:32

n78_1_40MHz_30kHz_3470MHz_DFT-s-OFDM
QPSK_RB100@0 -45.342MHz

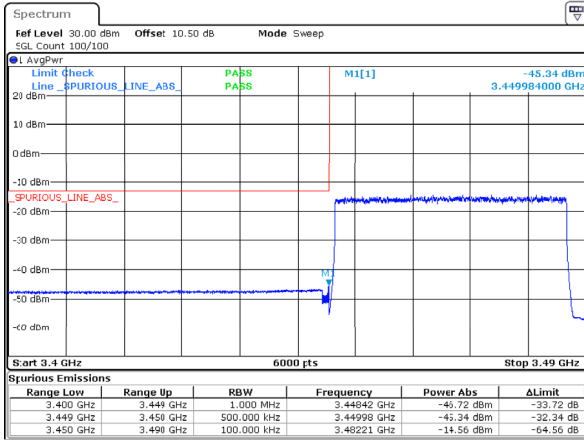


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:50:24

n78_1_40MHz_30kHz_3470MHz_DFT-s-OFDM
QPSK_RB1@0 -29.271MHz

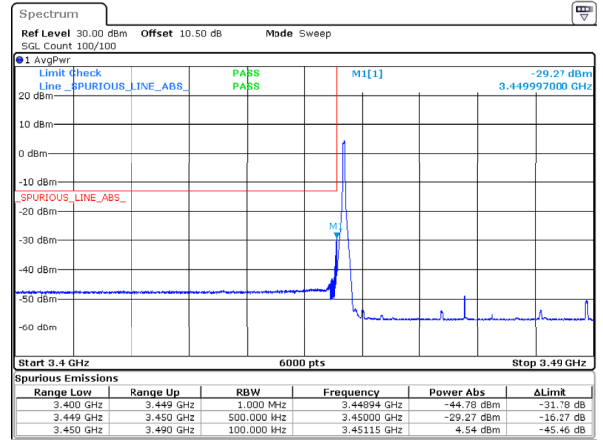


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:48:32

n78_1_40MHz_30kHz_3530MHz_DFT-s-OFDM
QPSK_RB100@0 -46.572MHz

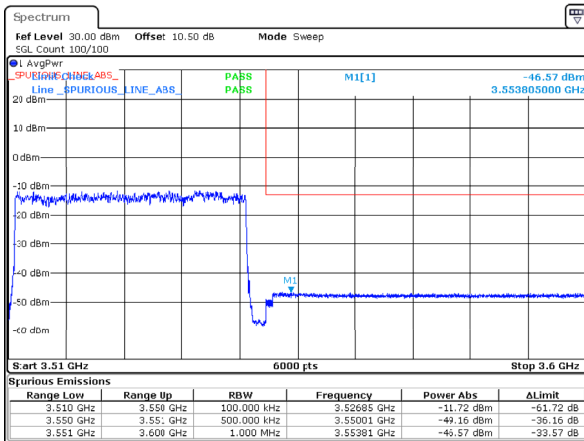


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 10.AUG.2024 10:23:22

n78_1_40MHz_30kHz_3530MHz_DFT-s-OFDM
QPSK_RB1@105 -29.695MHz

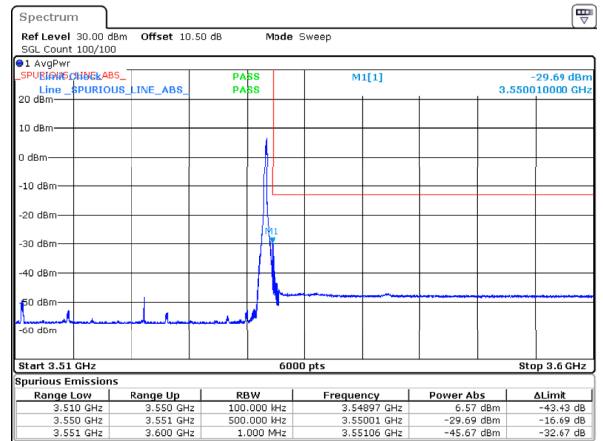


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 16:52:20

n78_1_50MHz_30kHz_3475MHz_DFT-s-OFDM
QPSK_RB128@0 -46.647MHz

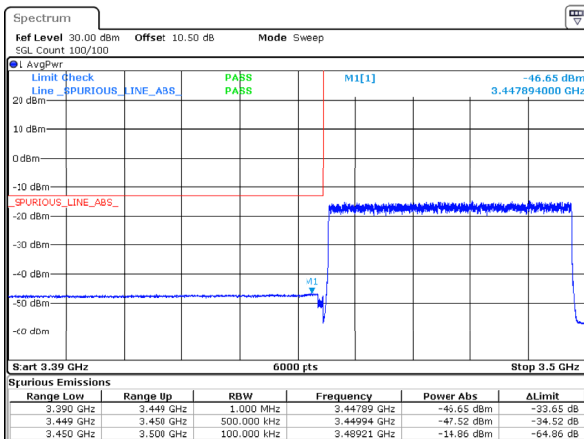


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 17:03:13

n78_1_50MHz_30kHz_3475MHz_DFT-s-OFDM
QPSK_RB1@0 -33.878MHz

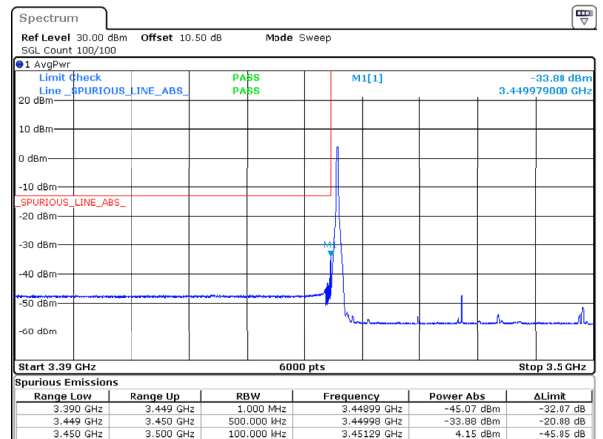


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 17:00:24

n78_1_50MHz_30kHz_3525MHz_DFT-s-OFDM
QPSK_RB128@0 -46.250MHz

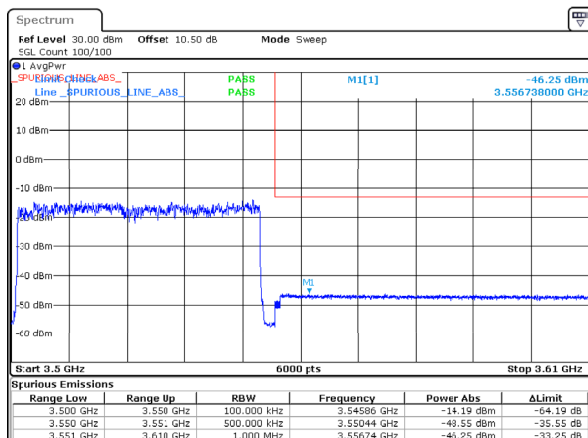


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:22:06

n78_1_50MHz_30kHz_3525MHz_DFT-s-OFDM
QPSK_RB1@132 -34.174MHz

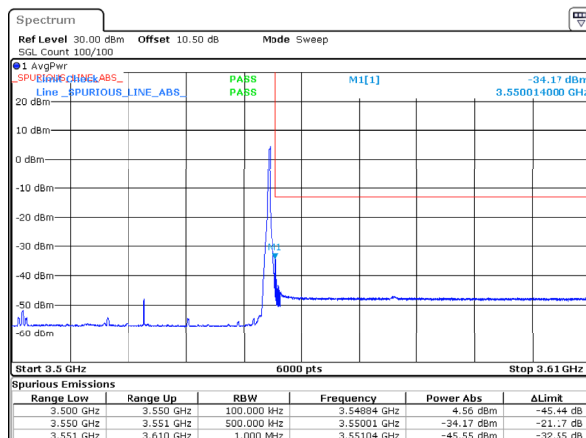


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 17:10:55

n78_1_60MHz_30kHz_3480MHz_DFT-s-OFDM
QPSK_RB162@0 -45.414MHz

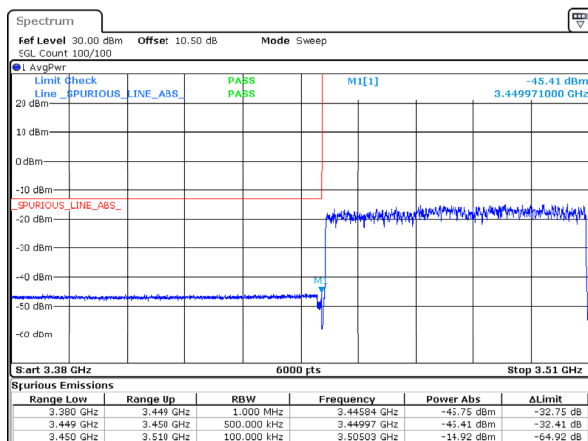


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:24:07

n78_1_60MHz_30kHz_3480MHz_DFT-s-OFDM
QPSK_RB1@0 -24.140MHz

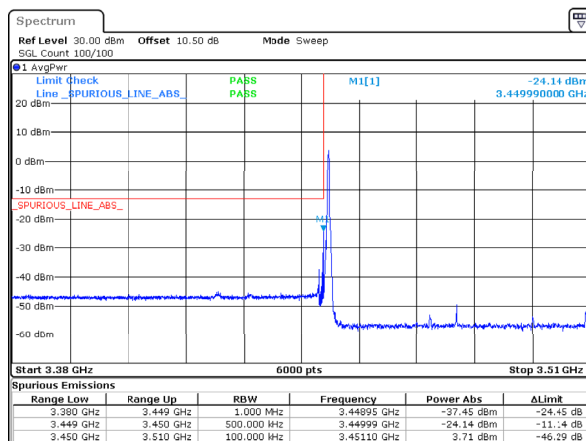


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:23:41

n78_1_60MHz_30kHz_3520MHz_DFT-s-OFDM
QPSK_RB162@0 -45.537MHz

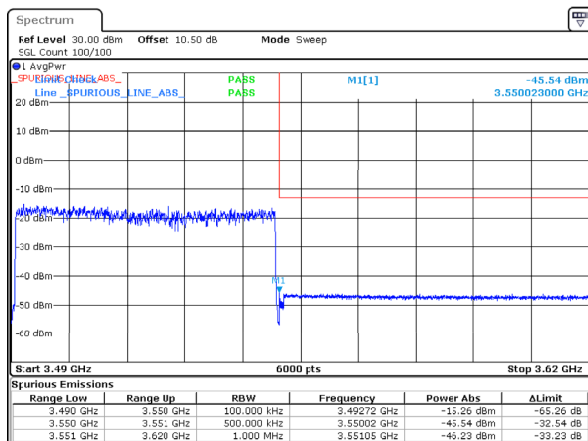


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:26:12

n78_1_60MHz_30kHz_3520MHz_DFT-s-OFDM
QPSK_RB1@161 -22.626MHz

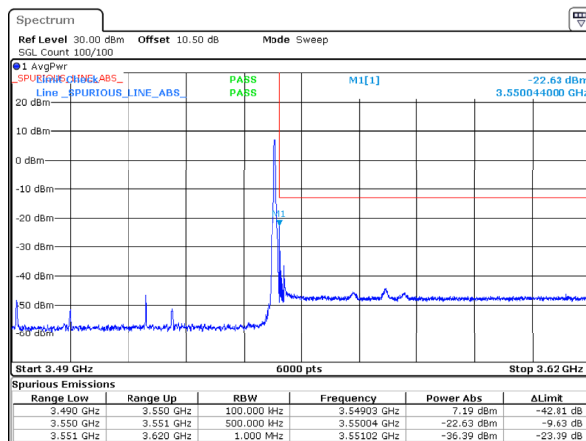


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 10.AUG.2024 10:28:40

n78_1_70MHz_30kHz_3485MHz_DFT-s-OFDM
QPSK_RB180@0 -45.902MHz

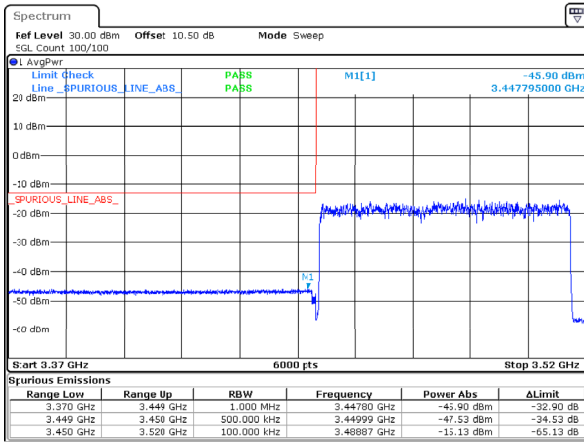


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:27:13

n78_1_70MHz_30kHz_3485MHz_DFT-s-OFDM
QPSK_RB1@0 -30.923MHz

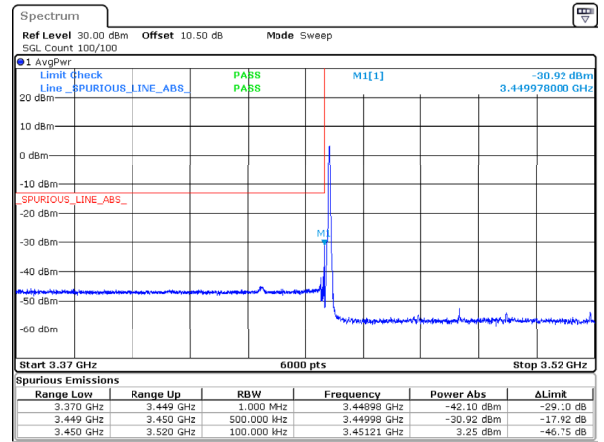


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:26:46

n78_1_70MHz_30kHz_3515MHz_DFT-s-OFDM
QPSK_RB180@0 -46.175MHz

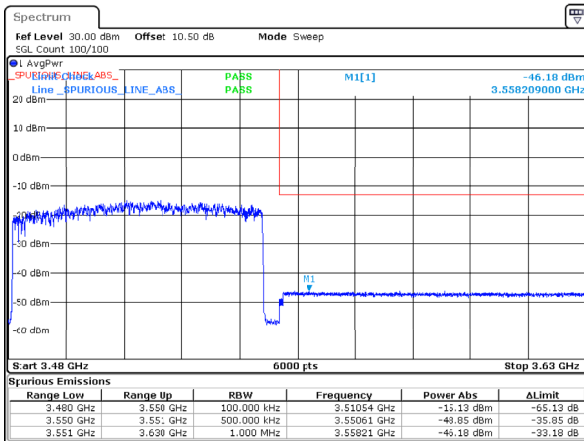


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:28:11

n78_1_70MHz_30kHz_3515MHz_DFT-s-OFDM
QPSK_RB1@188 -29.464MHz

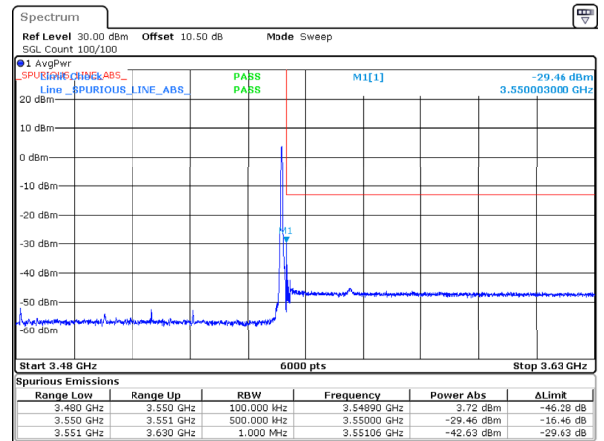


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:27:44

n78_1_80MHz_30kHz_3490MHz_DFT-s-OFDM
QPSK_RB1@0 -18.237MHz

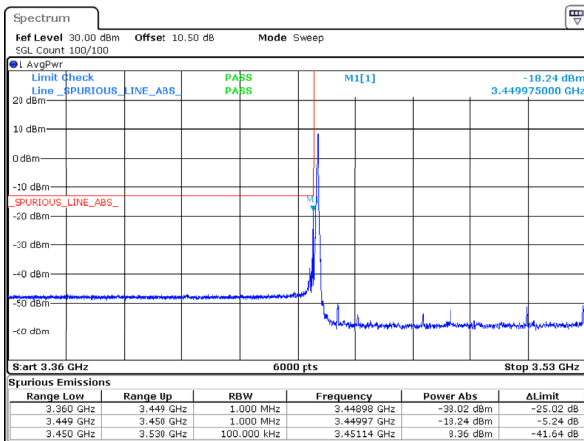


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 10.AUG.2024 10:35:05

n78_1_80MHz_30kHz_3490MHz_DFT-s-OFDM
QPSK_RB216@0 -25.840MHz

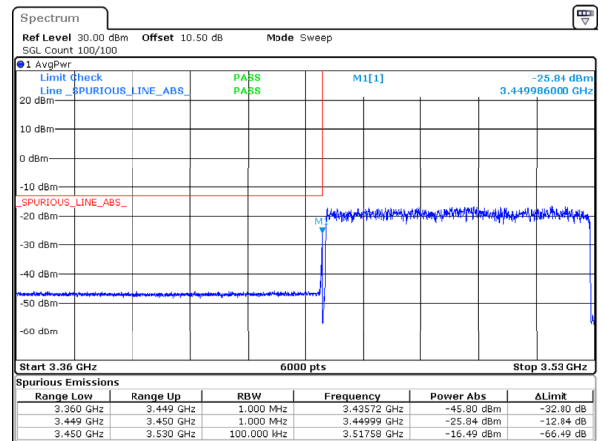


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:29:11

n78_1_80MHz_30kHz_3510MHz_DFT-s-OFDM
QPSK_RB1@216 -20.896MHz

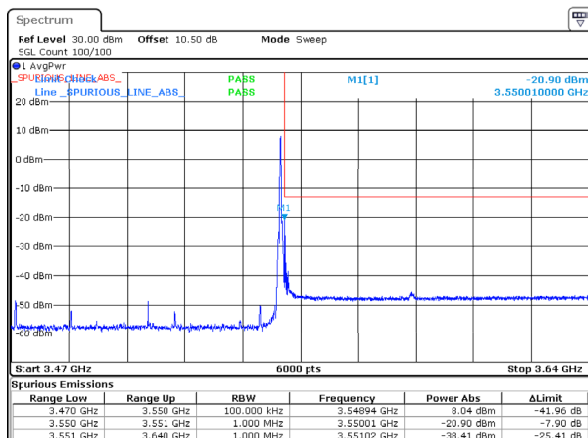


ProjectNo.: 2401U82760E-RF Tester: Jim Cheng
Date: 10. JUL. 2024 10:37:25

n78_1_80MHz_30kHz_3510MHz_DFT-s-OFDM
QPSK_RB216@0 -36.426MHz

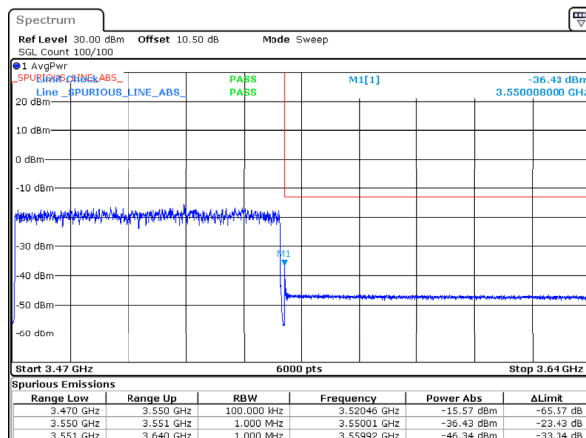


ProjectNo.: 2401U82760E-RF Tester: Jim Cheng
Date: 17. JUL. 2024 18:30:09

n78_1_90MHz_30kHz_3495MHz_DFT-s-OFDM
QPSK_RB1@0 -18.281MHz

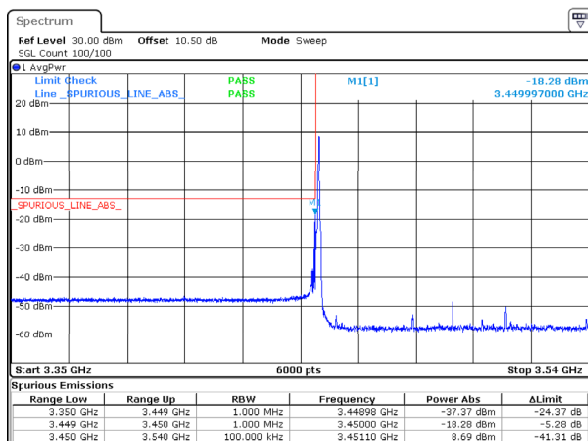


ProjectNo.: 2401U82760E-RF Tester: Jim Cheng
Date: 10. JUL. 2024 10:39:35

n78_1_90MHz_30kHz_3495MHz_DFT-s-OFDM
QPSK_RB243@0 -25.873MHz

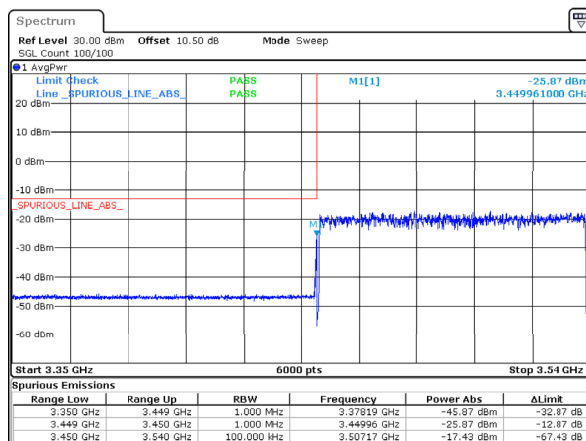


ProjectNo.: 2401U82760E-RF Tester: Jim Cheng
Date: 17. JUL. 2024 18:31:10

n78_1_90MHz_30kHz_3505MHz_DFT-s-OFDM
QPSK_RB1@244 -20.632MHz

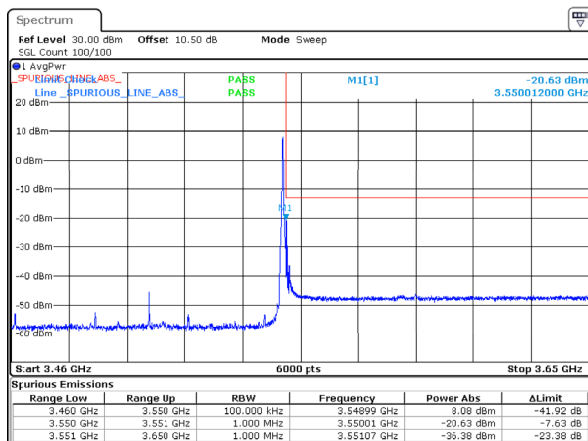


ProjectNo.: 2401U82760E-RF Tester: Jim Cheng
Date: 10. JUL. 2024 10:42:10

n78_1_90MHz_30kHz_3505MHz_DFT-s-OFDM
QPSK_RB243@0 -45.118MHz

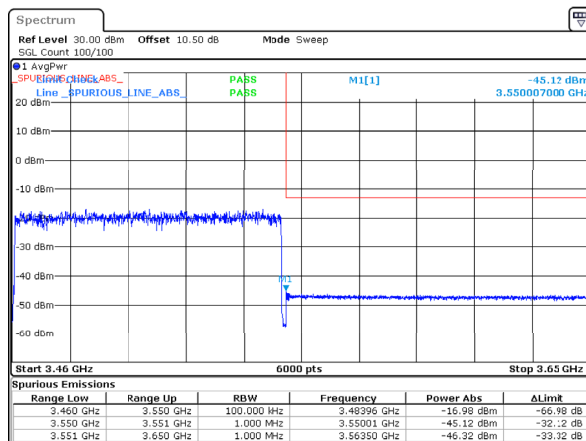


ProjectNo.: 2401U82760E-RF Tester: Jim Cheng
Date: 17. JUL. 2024 18:32:11

n78_1_100MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -17.663MHz

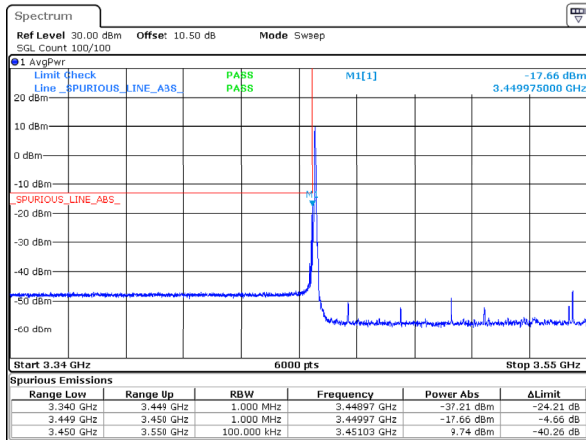


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 10.AUG.2024 10:44:05

n78_1_100MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB270@0 -26.141MHz

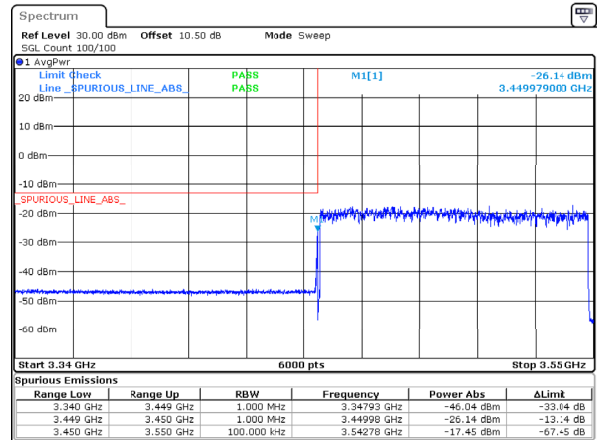


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:33:14

n78_1_100MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_R
B1@272 -17.470

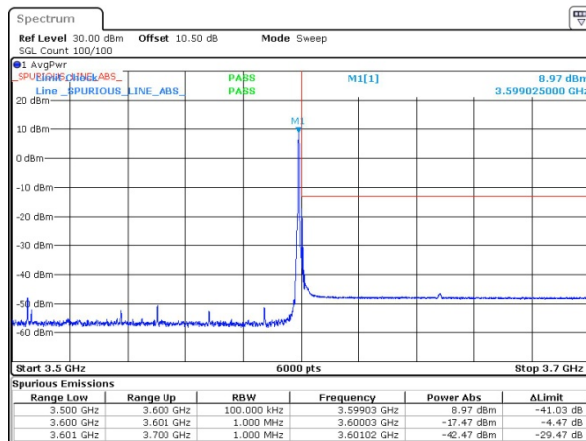

ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 13.AUG.2024 18:43:55


n78_1_100MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB270@0 -42.730MHz

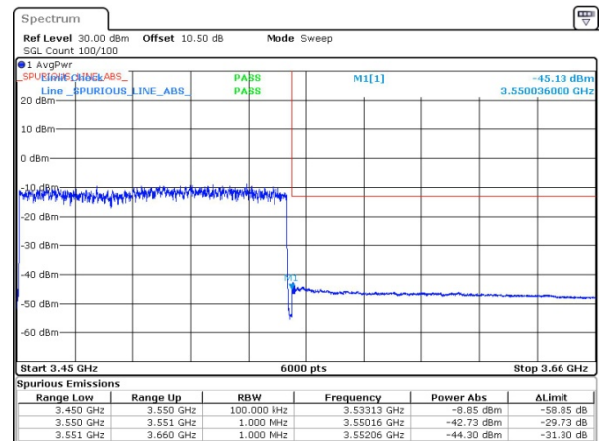

ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 14.AUG.2024 13:23:00


n78_3

n78_3_10MHz_30kHz_3705MHz_DFT-s-OFDM
QPSK_RB1@0 -30.589MHz

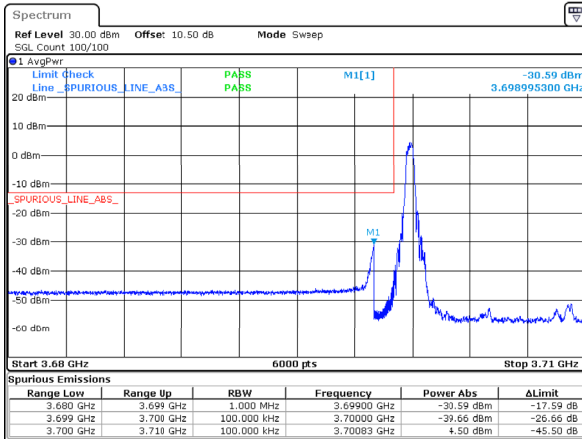


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:37:40

n78_3_10MHz_30kHz_3705MHz_DFT-s-OFDM
QPSK_RB24@0 -43.035MHz

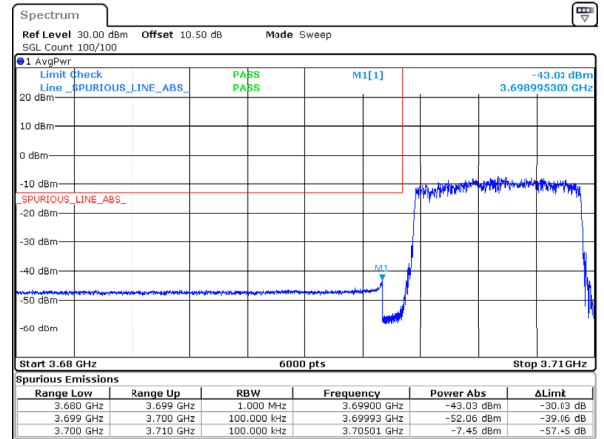


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:38:08

n78_3_10MHz_30kHz_3795MHz_DFT-s-OFDM
QPSK_RB1@23 -30.124MHz

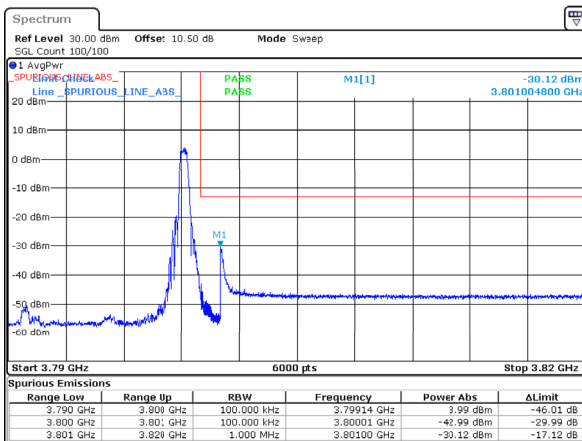


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:38:42

n78_3_10MHz_30kHz_3795MHz_DFT-s-OFDM
QPSK_RB24@0 -41.681MHz

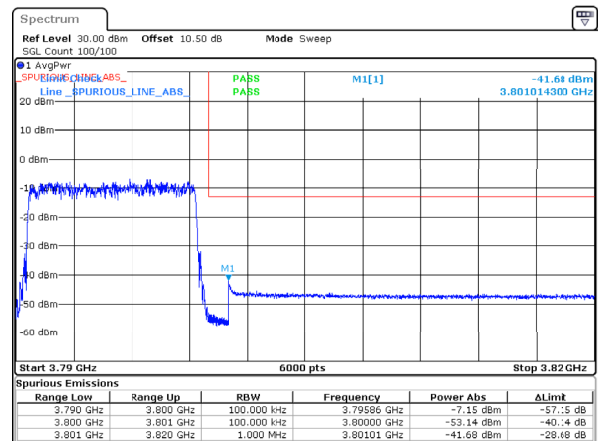


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:39:10

n78_3_15MHz_30kHz_3707.5MHz_DFT-s-OFDM
QPSK_RB1@0 -29.090MHz

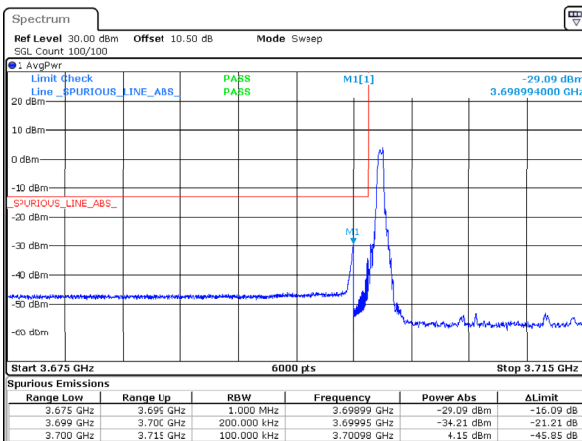


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:41:00

n78_3_15MHz_30kHz_3707.5MHz_DFT-s-OFDM
QPSK_RB36@0 -43.133MHz

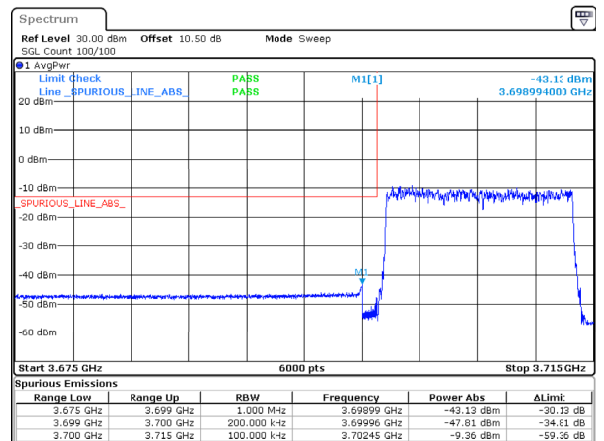


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:41:28

n78_3_15MHz_30kHz_3792.5MHz_DFT-s-OFDM
QPSK_RB1@37 -30.923MHz

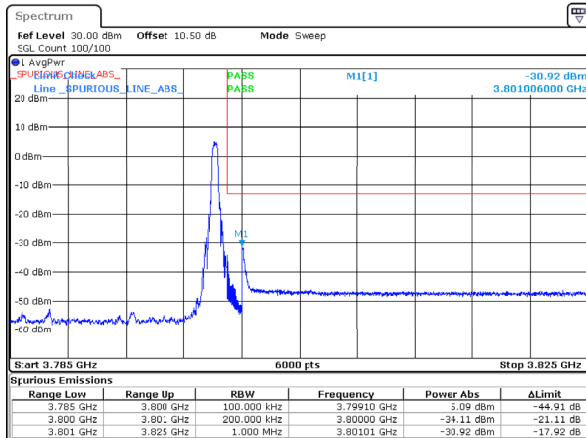


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:42:01

n78_3_15MHz_30kHz_3792.5MHz_DFT-s-OFDM
QPSK_RB36@0 -45.533MHz

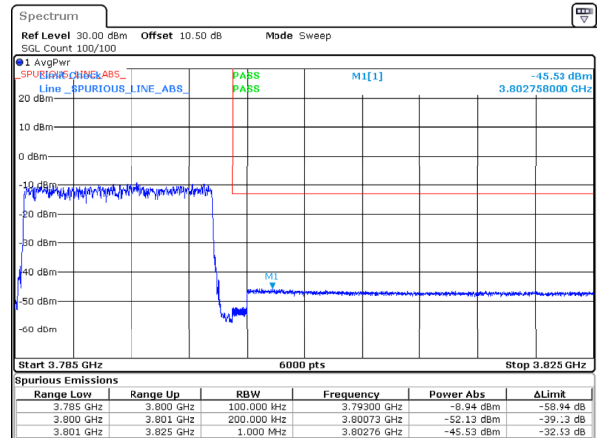


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:42:29

n78_3_20MHz_30kHz_3710MHz_DFT-s-OFDM
QPSK_RB1@0 -37.644MHz

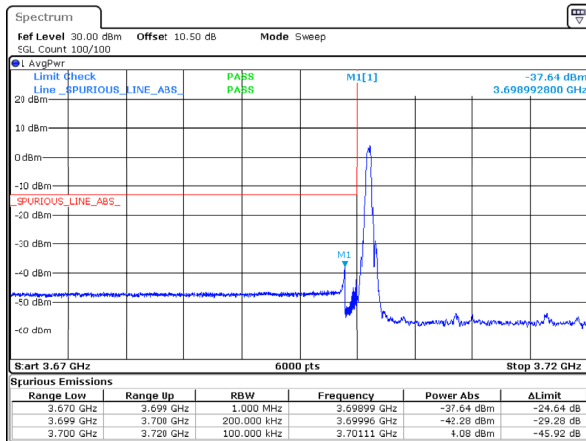


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:44:14

n78_3_20MHz_30kHz_3710MHz_DFT-s-OFDM
QPSK_RB50@0 -46.037MHz

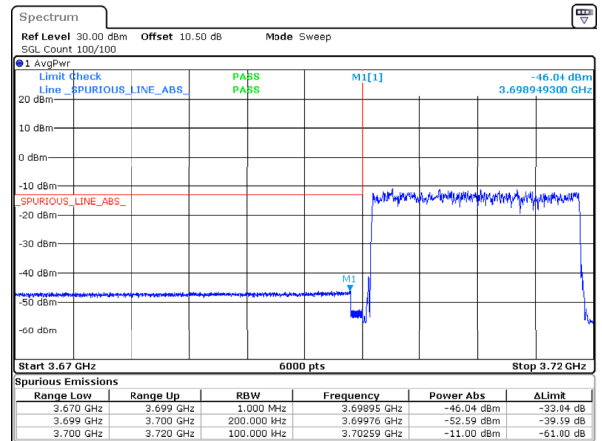


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:44:42

n78_3_20MHz_30kHz_3790MHz_DFT-s-OFDM
QPSK_RB1@50 -35.515MHz

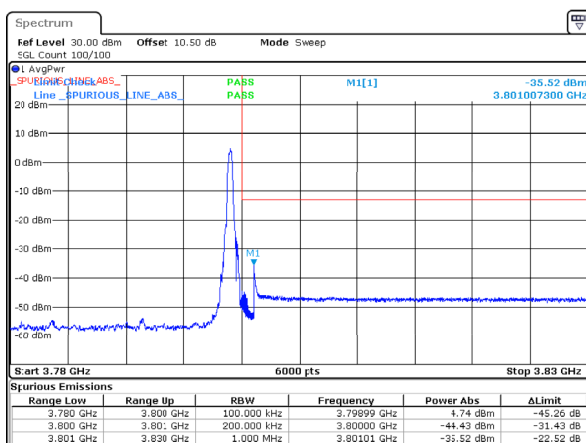


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:45:15

n78_3_20MHz_30kHz_3790MHz_DFT-s-OFDM
QPSK_RB50@0 -45.982MHz

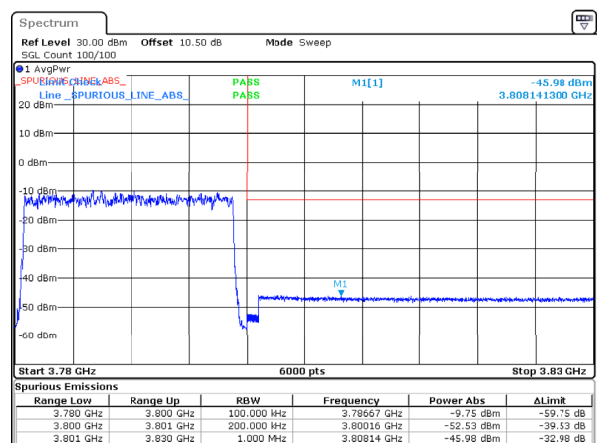


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:45:43

n78_3_30MHz_30kHz_3715MHz_DFT-s-OFDM
QPSK_RB1@0 -29.671MHz

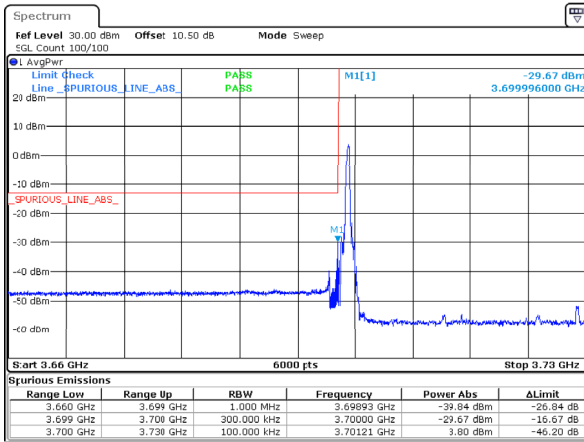


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:47:25

n78_3_30MHz_30kHz_3715MHz_DFT-s-OFDM
QPSK_RB75@0 -46.175MHz

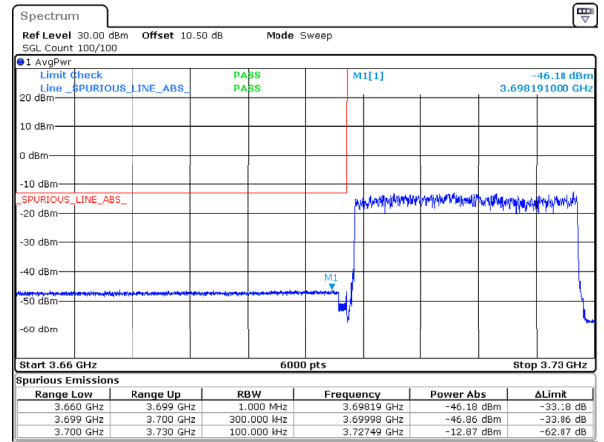


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:47:55

n78_3_30MHz_30kHz_3785MHz_DFT-s-OFDM
QPSK_RB1@77 -33.833MHz

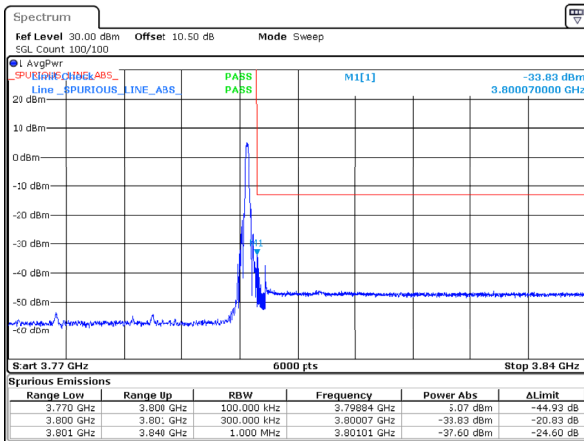


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:48:29

n78_3_30MHz_30kHz_3785MHz_DFT-s-OFDM
QPSK_RB75@0 -45.955MHz

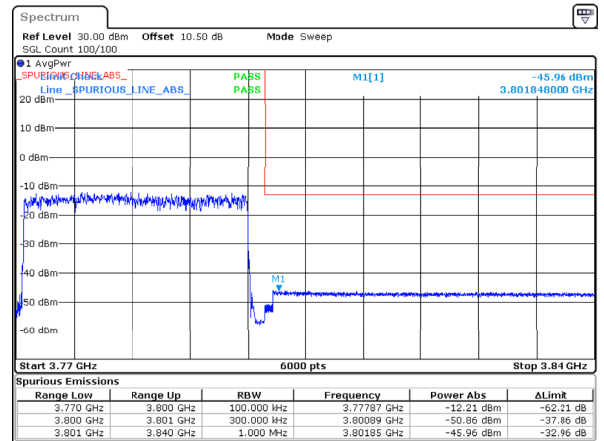


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:49:00

n78_3_40MHz_30kHz_3720MHz_DFT-s-OFDM
QPSK_RB100@0 -42.486MHz

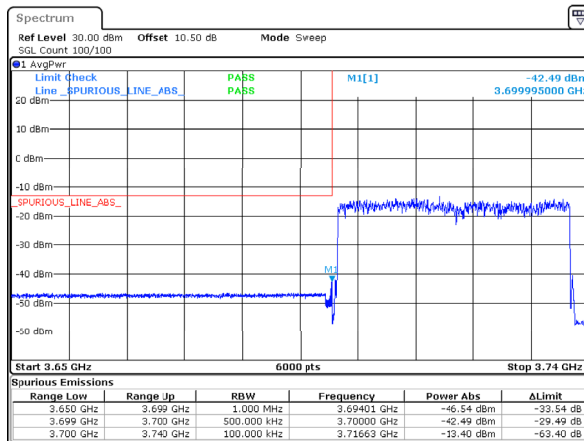


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:52:11

n78_3_40MHz_30kHz_3720MHz_DFT-s-OFDM
QPSK_RB1@0 -22.810MHz

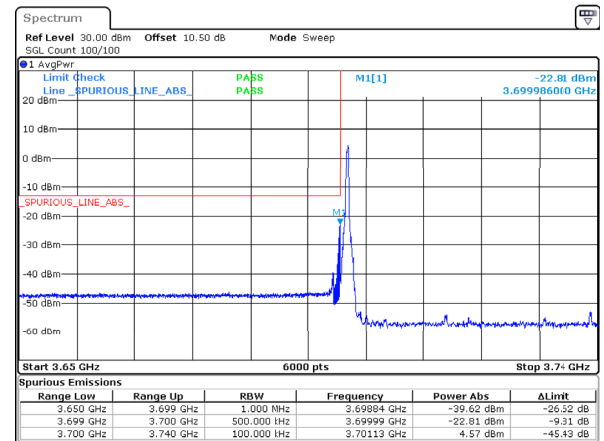


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:51:42

n78_3_40MHz_30kHz_3780MHz_DFT-s-OFDM
QPSK_RB100@0 -46.450MHz

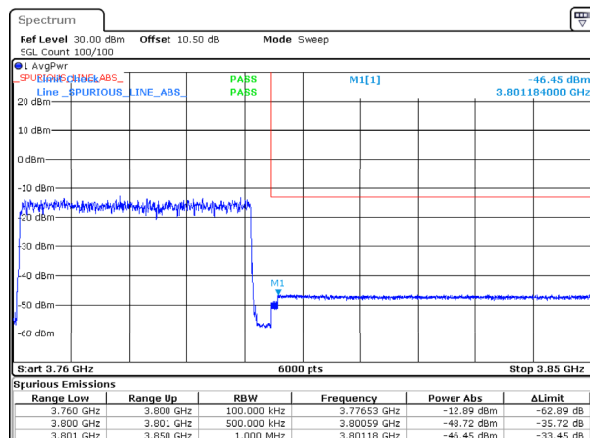


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:53:22

n78_3_40MHz_30kHz_3780MHz_DFT-s-OFDM
QPSK_RB1@105 -24.478MHz

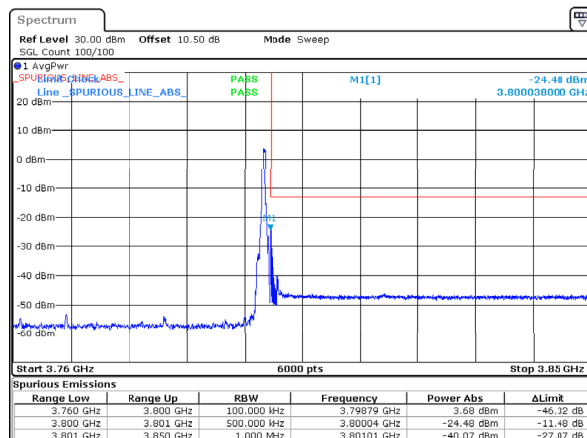


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:52:50

n78_3_50MHz_30kHz_3725MHz_DFT-s-OFDM
QPSK_RB128@0 -46.052MHz

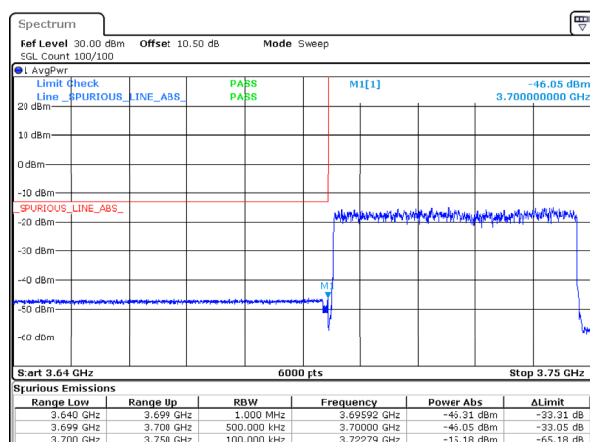


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:55:41

n78_3_50MHz_30kHz_3725MHz_DFT-s-OFDM
QPSK_RB1@0 -28.795MHz

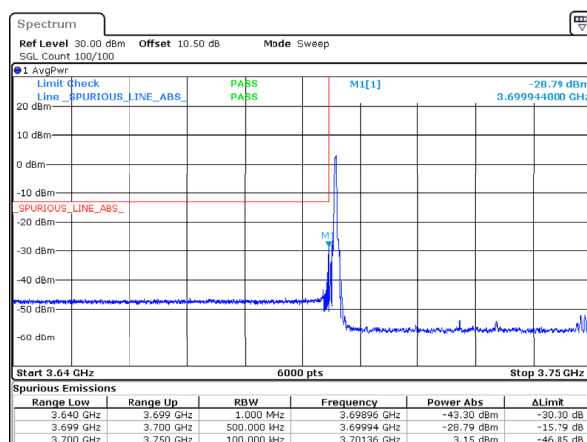


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:55:09

n78_3_50MHz_30kHz_3775MHz_DFT-s-OFDM
QPSK_RB128@0 -45.947MHz

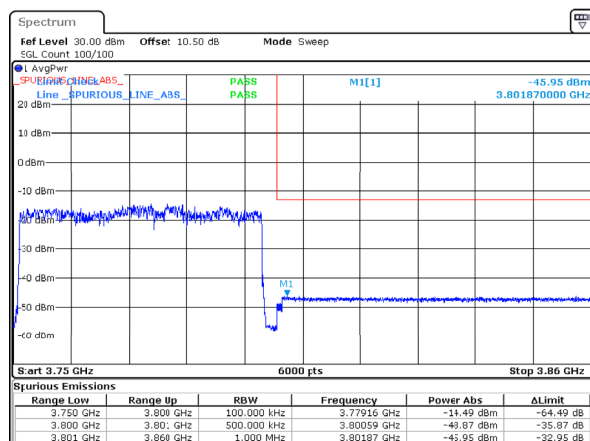


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:56:50

n78_3_50MHz_30kHz_3775MHz_DFT-s-OFDM
QPSK_RB1@132 -28.685MHz

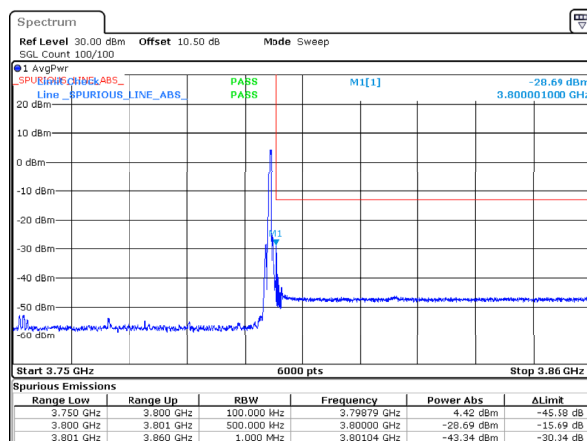


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 18:56:18

n78_3_60MHz_30kHz_3730MHz_DFT-s-OFDM
QPSK_RB162@0 -45.143MHz

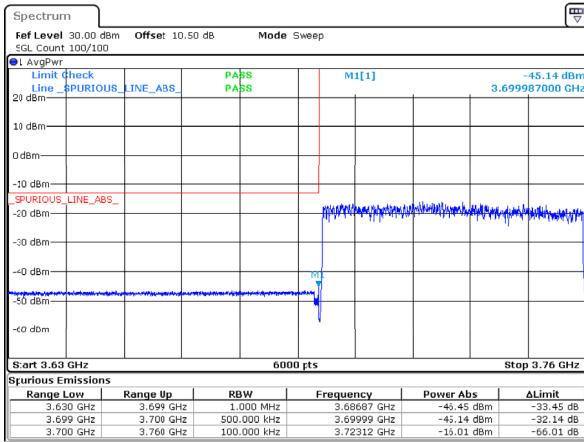


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:06:57

n78_3_60MHz_30kHz_3730MHz_DFT-s-OFDM
QPSK_RB1@0 -25.425MHz

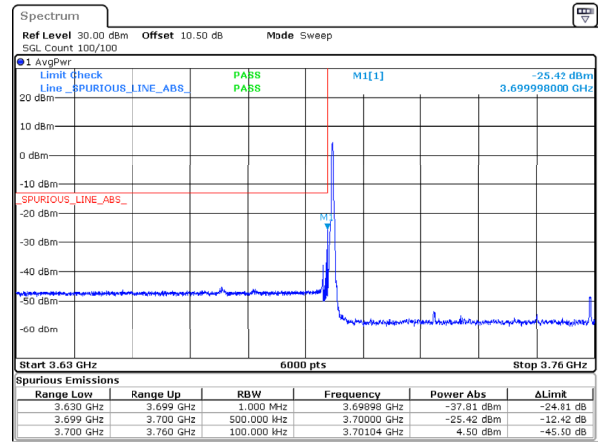


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:06:26

n78_3_60MHz_30kHz_3770MHz_DFT-s-OFDM
QPSK_RB162@0 -43.491MHz

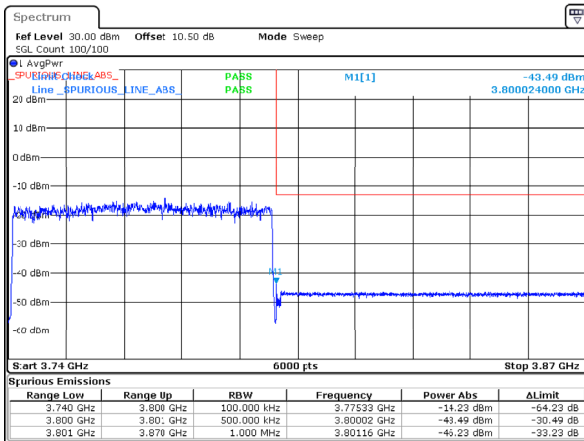


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:08:12

n78_3_60MHz_30kHz_3770MHz_DFT-s-OFDM
QPSK_RB1@161 -25.362MHz

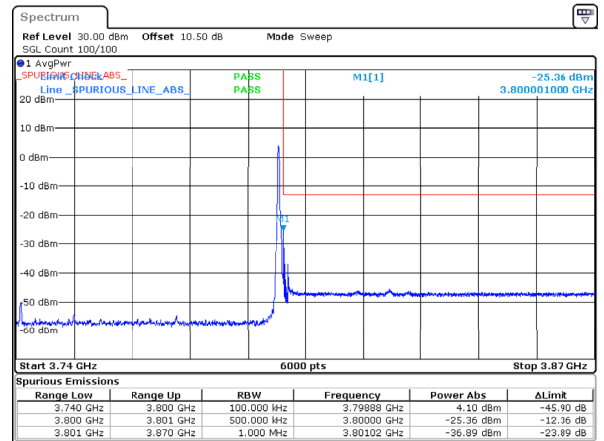


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:07:40

n78_3_70MHz_30kHz_3735MHz_DFT-s-OFDM
QPSK_RB180@0 -46.593MHz

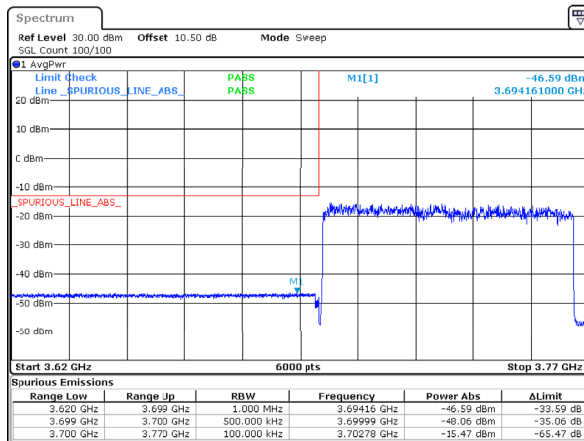


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:13:01

n78_3_70MHz_30kHz_3735MHz_DFT-s-OFDM
QPSK_RB1@0 -32.449MHz

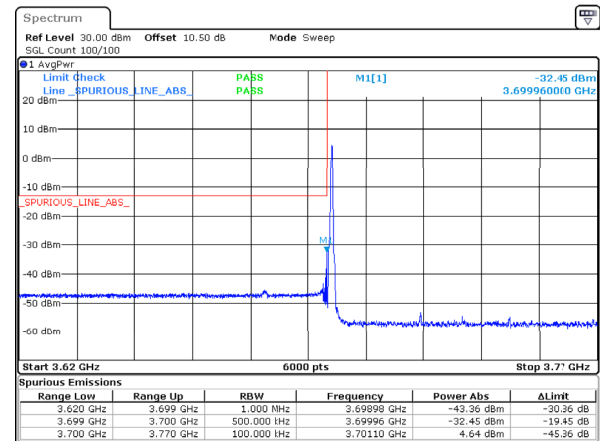


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:12:29

n78_3_70MHz_30kHz_3765MHz_DFT-s-OFDM
QPSK_RB180@0 -46.508MHz

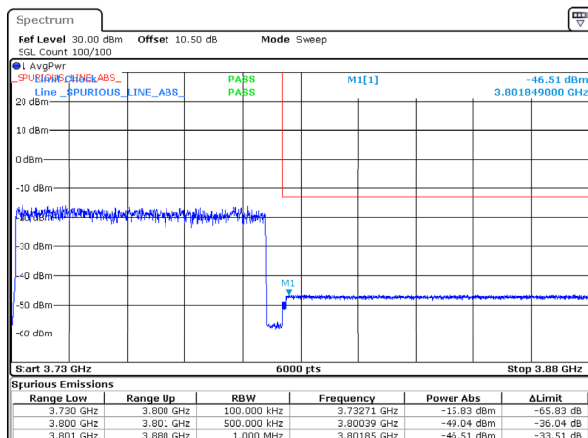


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:14:10

n78_3_70MHz_30kHz_3765MHz_DFT-s-OFDM
QPSK_RB1@188 -31.213MHz

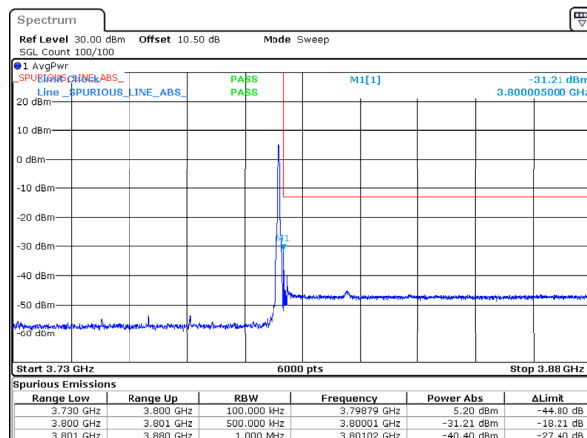


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:13:37

n78_3_80MHz_30kHz_3740MHz_DFT-s-OFDM
QPSK_RB1@0 -20.587MHz

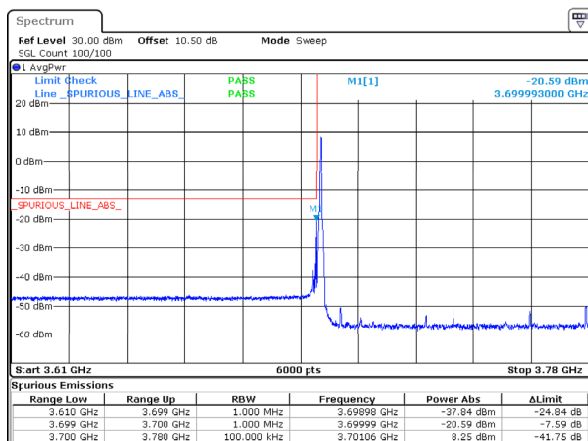


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 10.AUG.2024 12:01:15

n78_3_80MHz_30kHz_3740MHz_DFT-s-OFDM
QPSK_RB216@0 -27.007MHz

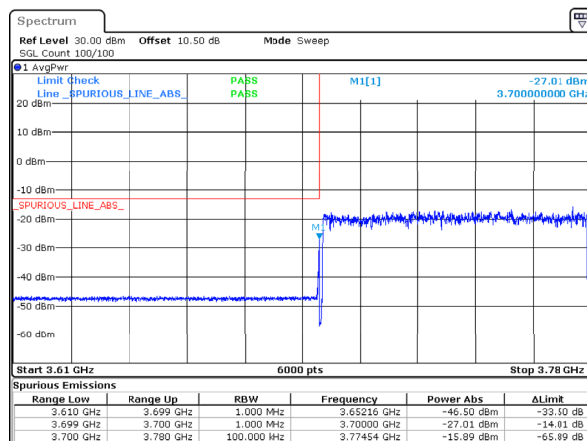


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:18:13

n78_3_80MHz_30kHz_3760MHz_DFT-s-OFDM
QPSK_RB1@216 -20.497MHz

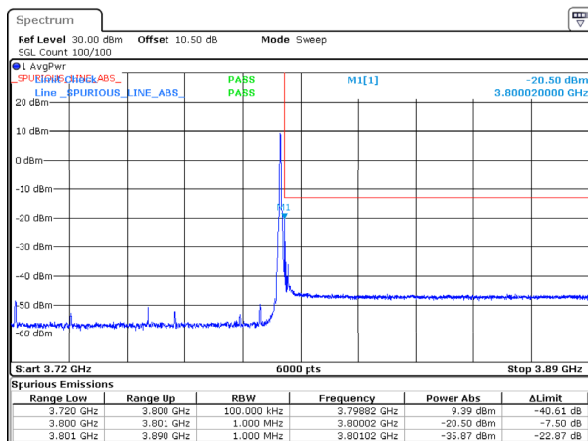


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 10.AUG.2024 12:02:53

n78_3_80MHz_30kHz_3760MHz_DFT-s-OFDM
QPSK_RB216@0 -36.843MHz

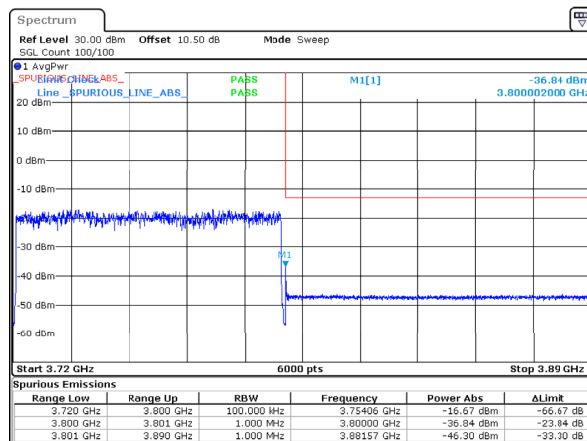


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:19:23

n78_3_90MHz_30kHz_3745MHz_DFT-s-OFDM
QPSK_RB1@0 -19.771MHz

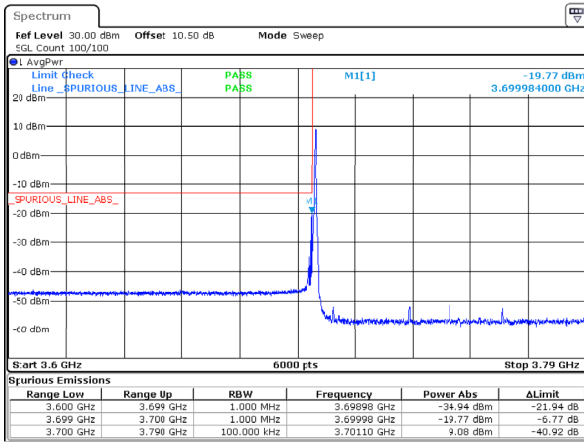


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 10.AUG.2024 12:15:06

n78_3_90MHz_30kHz_3745MHz_DFT-s-OFDM
QPSK_RB243@0 -26.471MHz

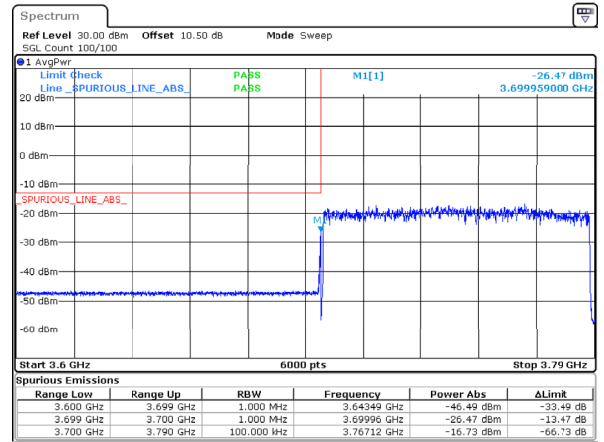


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:23:52

n78_3_90MHz_30kHz_3755MHz_DFT-s-OFDM
QPSK_RB1@244 -22.036MHz

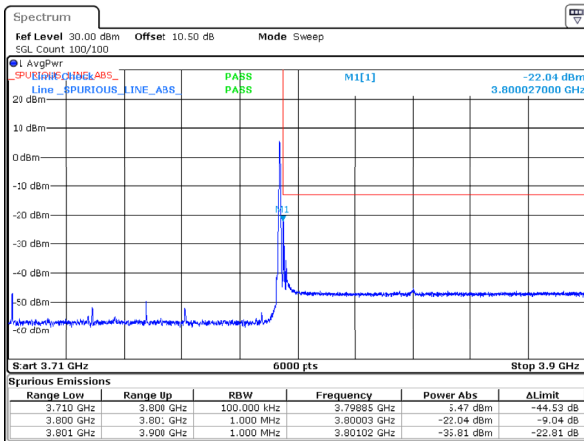


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 10.AUG.2024 12:16:33

n78_3_90MHz_30kHz_3755MHz_DFT-s-OFDM
QPSK_RB243@0 -44.630MHz

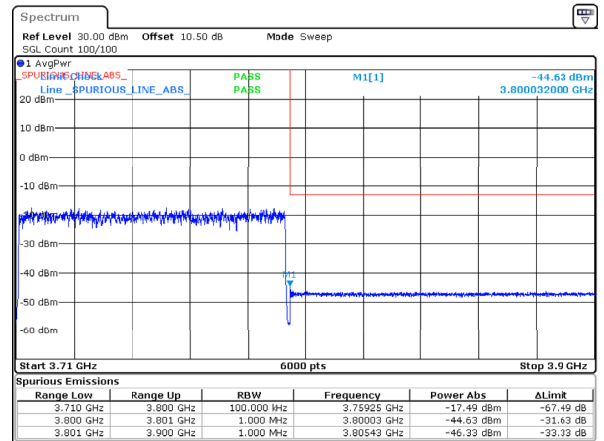


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 19:25:03

n78_3_100MHz_30kHz_3750MHz_DFT-s-OFDM
QPSK_RB1@0 -18.645MHz

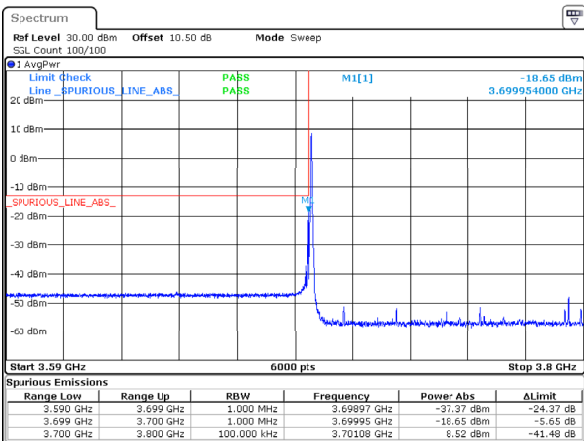


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 10.AUG.2024 12:18:43

n78_3_100MHz_30kHz_3750MHz_DFT-s-OFDM
QPSK_RB270@0 -24.957MHz

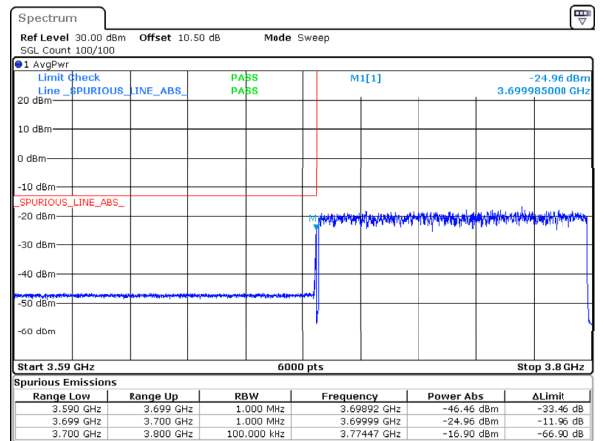


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 17.JUL.2024 15:27:25

n78_3_100MHz_30kHz_3750MHz_DFT-s-OFDM
QPSK_RB1@272 -18.190MHz

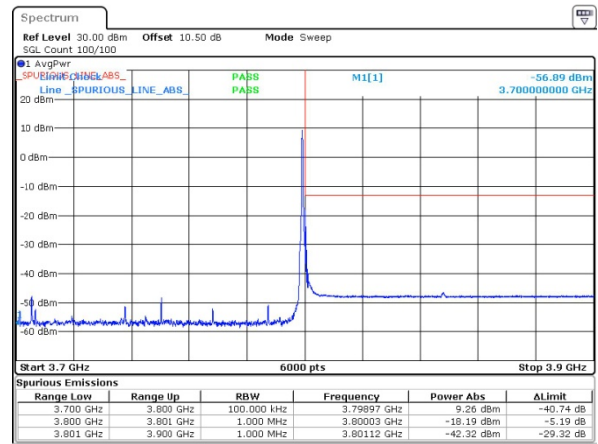

ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 13.AUG.2024 18:47:05

n78_3_100MHz_30kHz_3750MHz_DFT-s-OFDM
QPSK_RB270@0 -41.270MHz

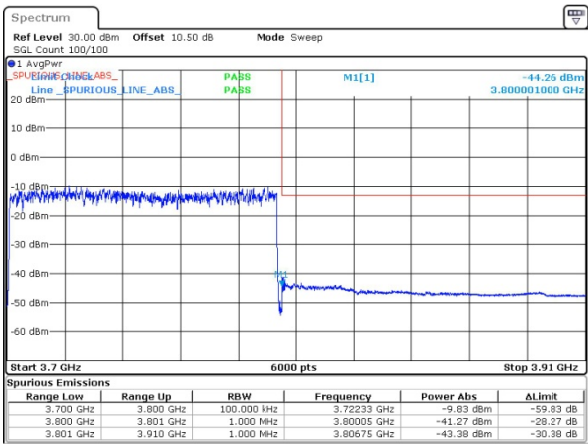

ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 14.AUG.2024 13:20:49