

Appendix E5

Test Information:

Serial No.:	3J02-1	Test Date:	2026/04/13
Test Site:	RF	Test Mode:	Transmitting
Tester:	Loge Long	Test Result:	Pass

Environmental Conditions:

Temperature: (°C)	24.2	Relative Humidity: (%)	49	ATM Pressure: (kPa)	100.4
----------------------	------	---------------------------	----	------------------------	-------

Test Equipment List and Details:


Manufacturer	Description	Model	Serial Number	Calibration Date	Calibration Due Date
R&S	Spectrum Analyzer	FSV40	101947	2025/07/28	2026/07/27
Micro-Coax	Coaxial Cable	UFB205A	323190-034	2025/09/04	2026/09/03
Anritsu	Radio Communication Test Station	MT8000A	6272709229	2025/09/21	2026/09/20
Minl-Clrcuts	Coaxial Power Splitters & Combiner	ZFRSC-183-S+	SF448201614	2026/02/24	2027/02/23
JD	Test Software	JD Auto Test System	V1.0	N/A	N/A

* Statement of Traceability: Bay Area Compliance Laboratories Corp. (Dongguan) attests that all calibrations have been performed, traceable to National Primary Standards and International System of Units (SI).

Out of band emission,Band Edge
 FCC Part 96


n77_2

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0

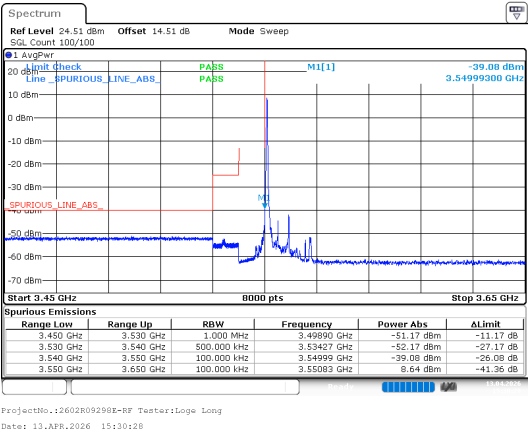


ProjectNo.:2602R09298E-RF Testeri:Loge Long
 Date: 13.APR.2026 15:10:28

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0

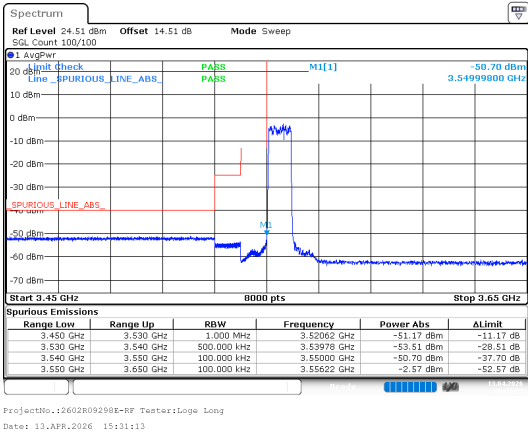


ProjectNo.:2602R09298E-RF Testeri:Loge Long
 Date: 13.APR.2026 15:31:13

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23

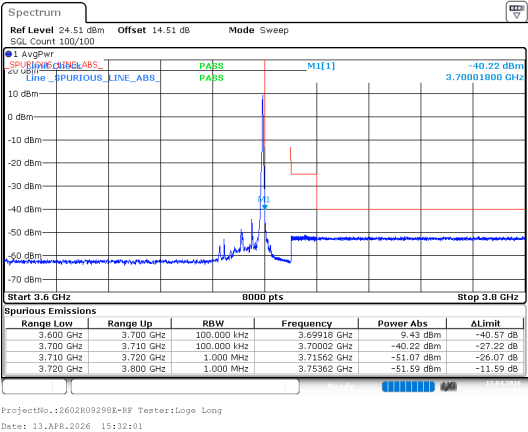


ProjectNo.:2602R09298E-RF Testeri:Loge Long
 Date: 13.APR.2026 15:32:01

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0

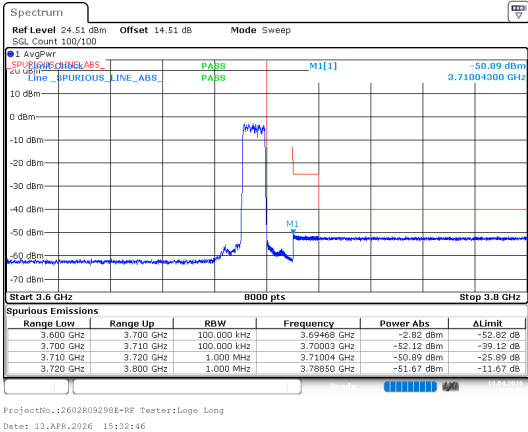


ProjectNo.:2602R09298E-RF Testeri:Loge Long
 Date: 13.APR.2026 15:32:46

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0

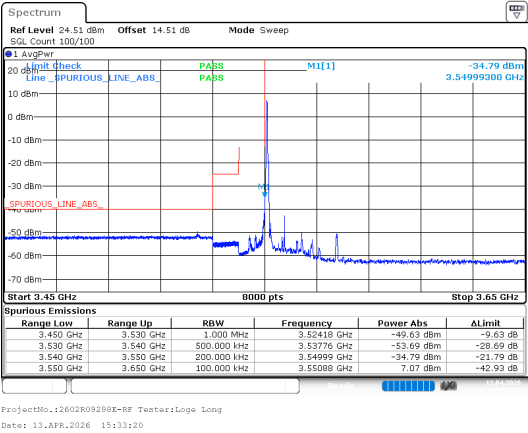

ProjectNo.:2602R09298E-RF Testeri:Loge Long
 Date: 13.APR.2026 15:33:20


n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0

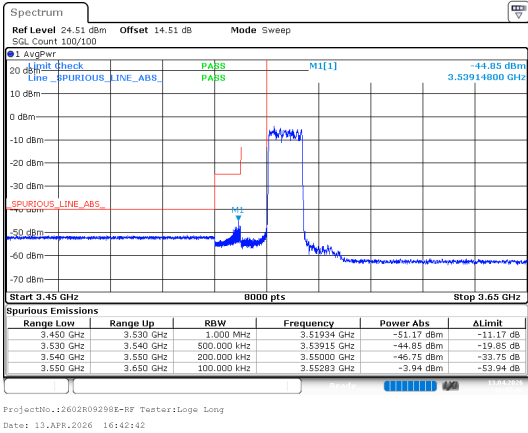

ProjectNo.:2602R09298E-RF Testeri:Loge Long
 Date: 13.APR.2026 16:42:42


n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM

QPSK_RB1@37

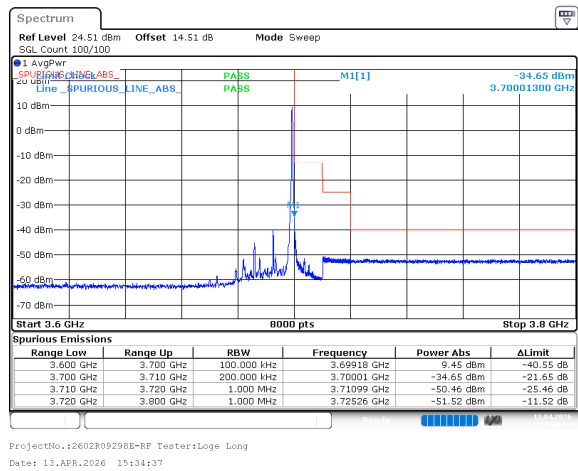


n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM


QPSK_RB36@0

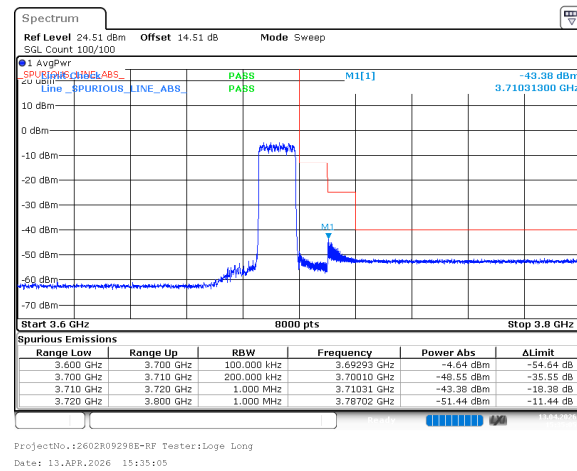


n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0

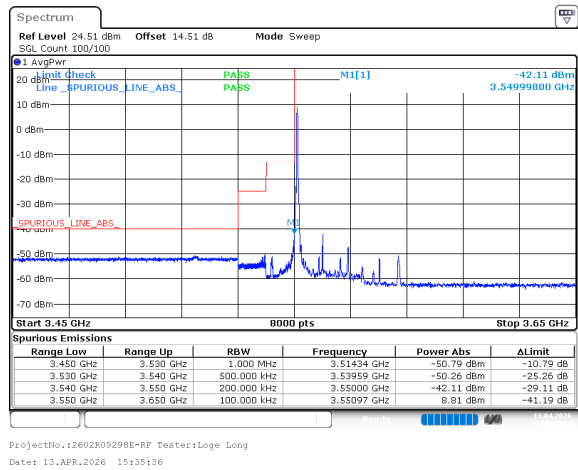


n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0

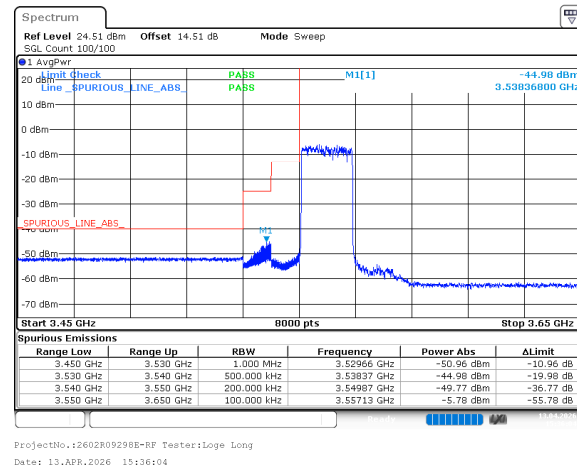


n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50

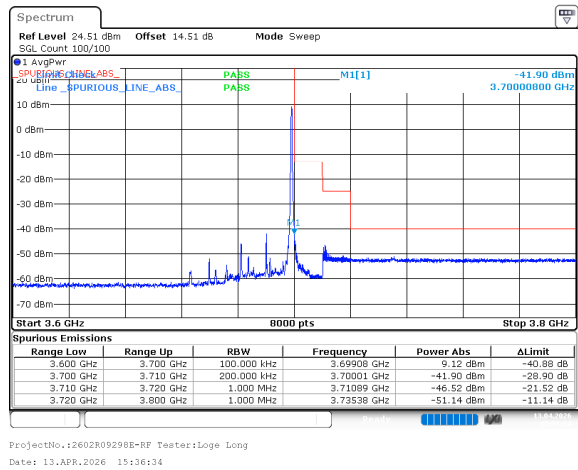

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0

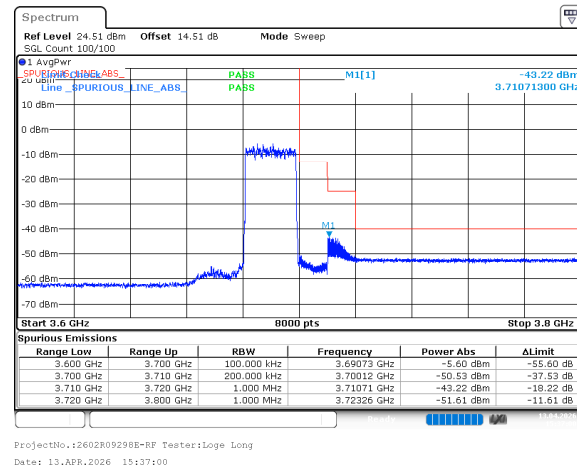


n77_2_25MHz_30kHz_3562.5MHz_DFT-s-OFDM
QPSK_RB1@0

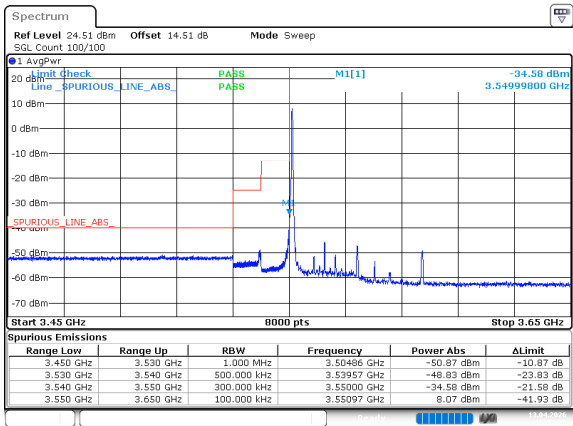


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:37:28

n77_2_25MHz_30kHz_3562.5MHz_DFT-s-OFDM
QPSK_RB64@0

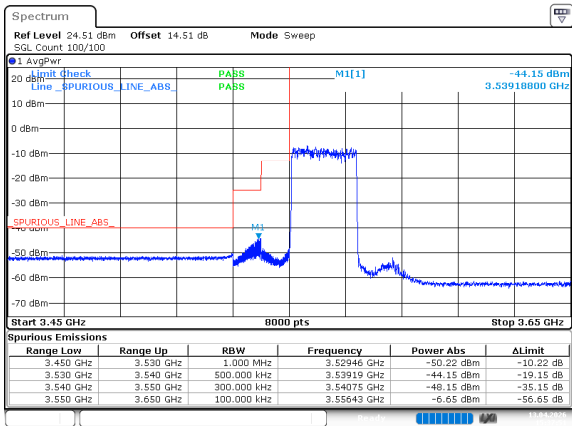


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:37:51

n77_2_25MHz_30kHz_3687.5MHz_DFT-s-OFDM
QPSK_RB1@64

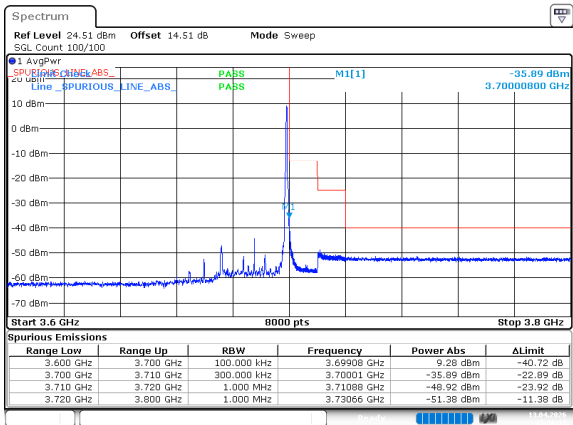


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:38:17

n77_2_25MHz_30kHz_3687.5MHz_DFT-s-OFDM
QPSK_RB64@0

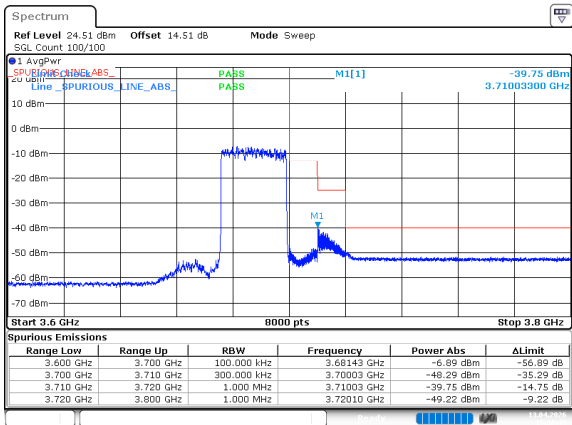


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:38:43

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0 n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0

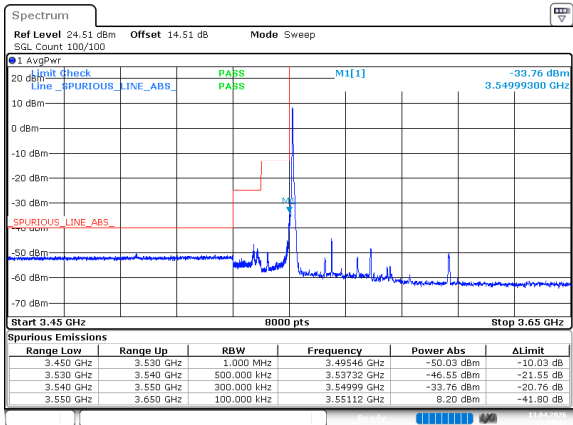


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:39:12

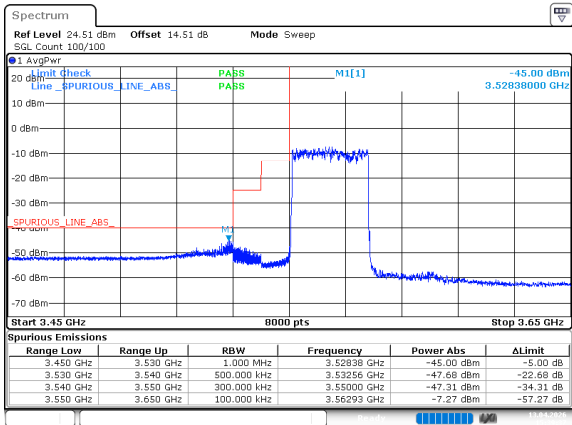


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:39:37

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0

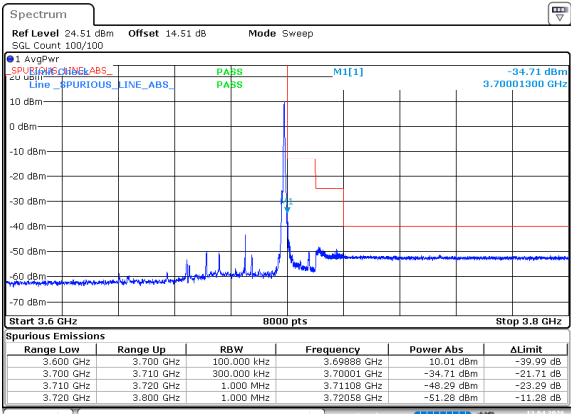


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:40:05

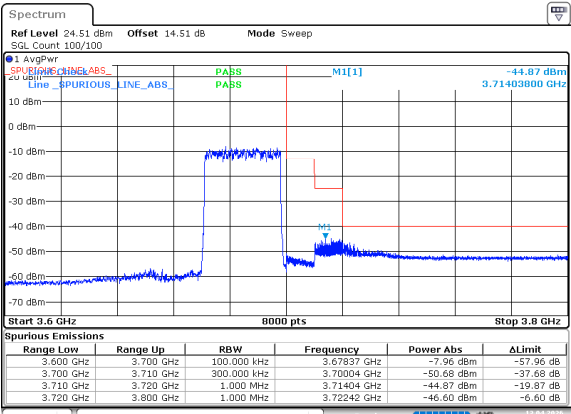


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:40:31

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0

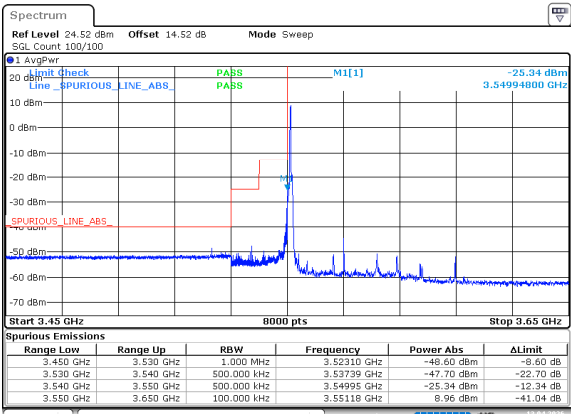


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:41:01

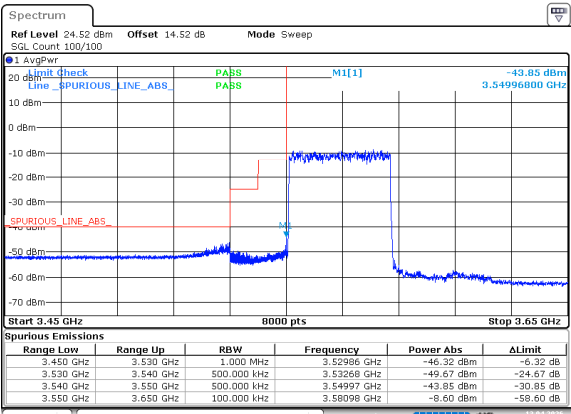


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:41:26

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105

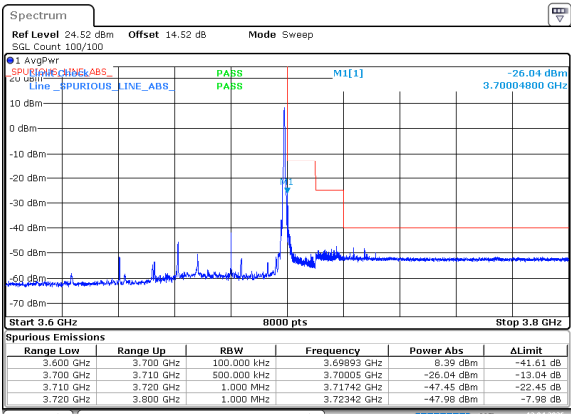


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:41:54

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0

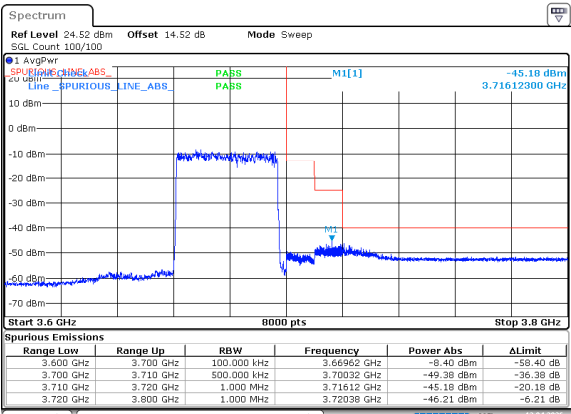


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:42:18

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0

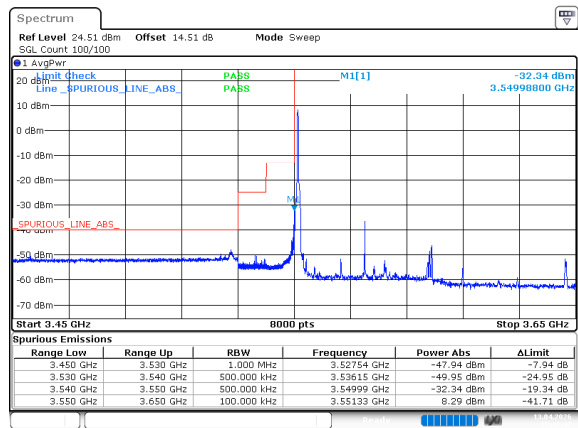


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:42:47

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0

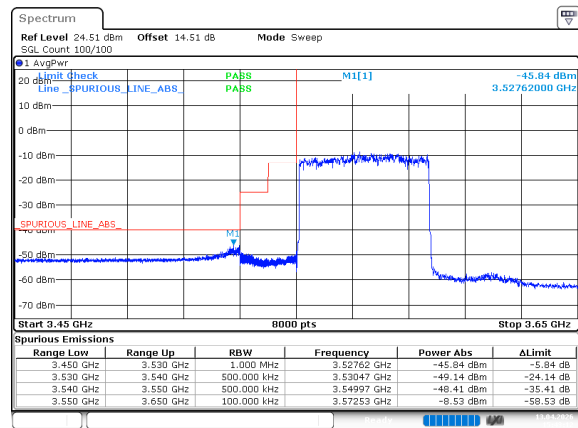


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:43:12

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132

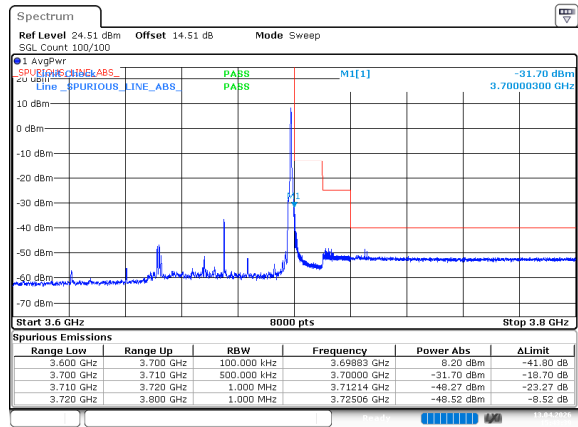


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:43:39

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0

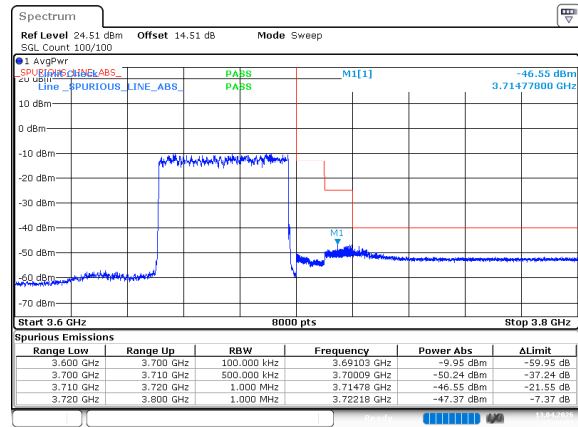


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:44:03

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0

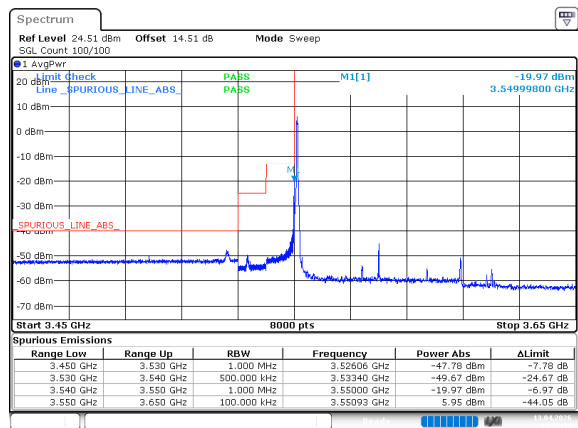

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:35:34


n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0

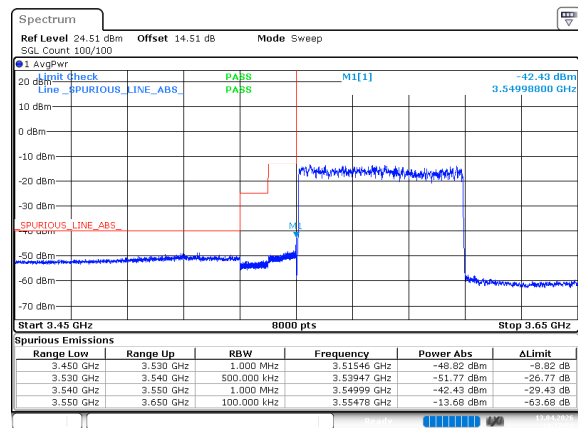

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:17:51

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM


QPSK_RB1@161

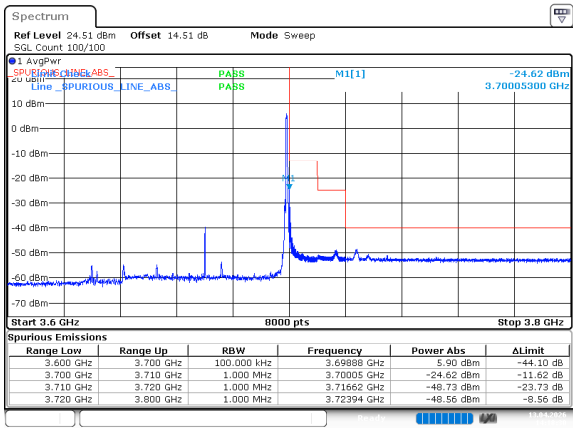

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:18:30

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM


QPSK_RB162@0

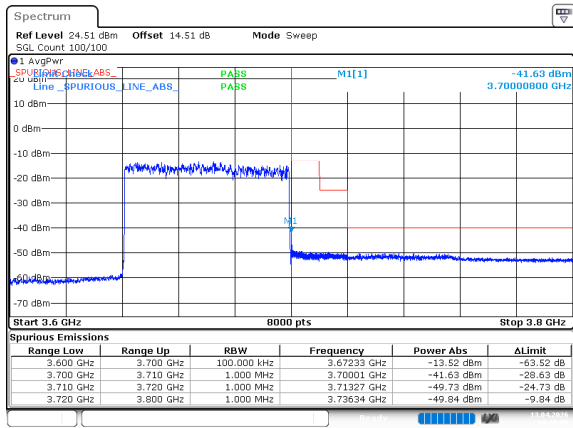

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:19:05

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM


QPSK_RB1@0

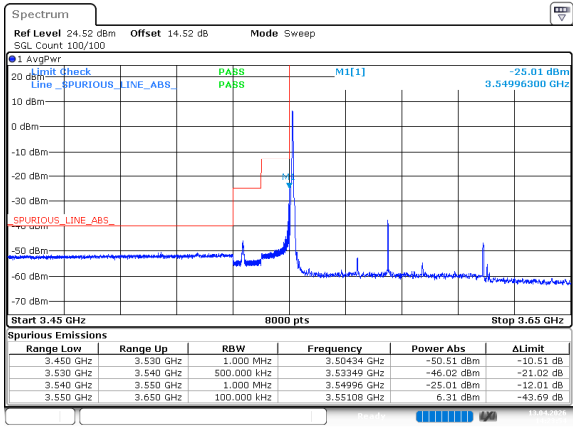

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:23:55

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM


QPSK_RB180@0

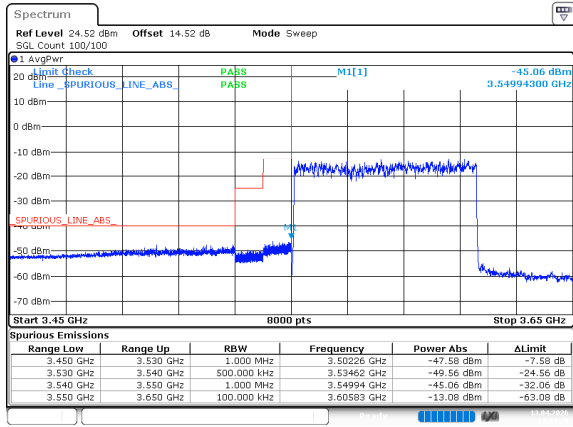

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:24:30

n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM


QPSK_RB1@188

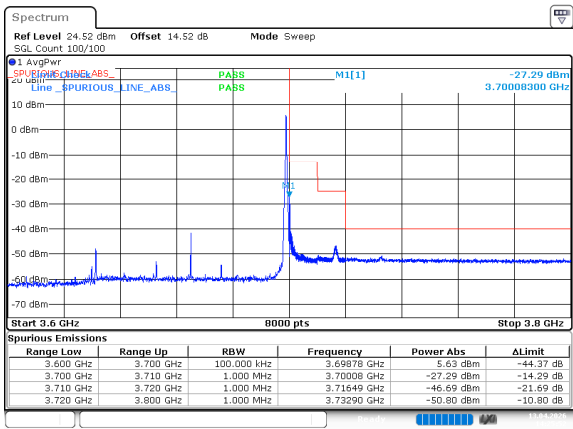

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:25:53


n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM

QPSK_RB180@0

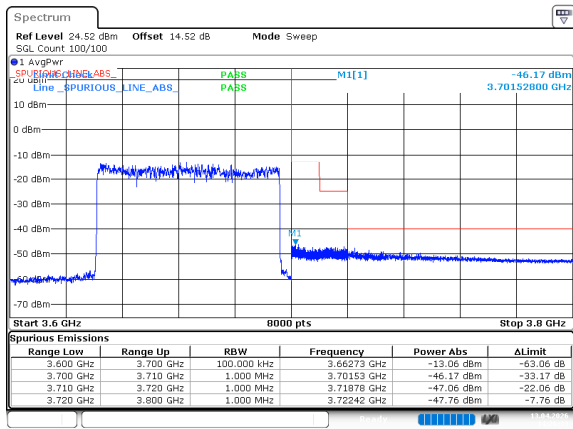


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:26:34

n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0

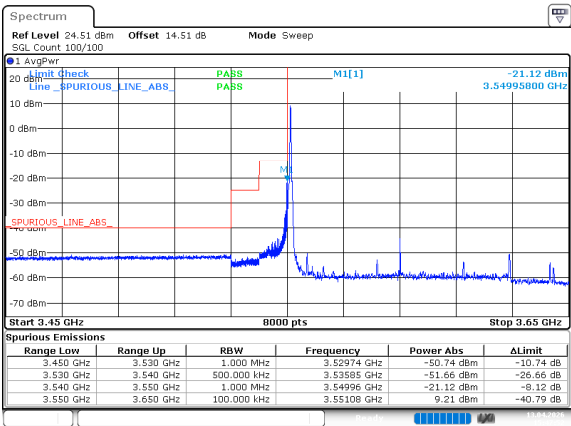


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:47:52

n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB216@0

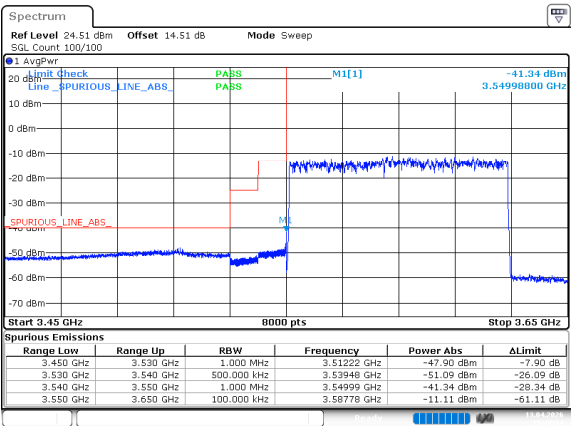


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:48:14

n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@216

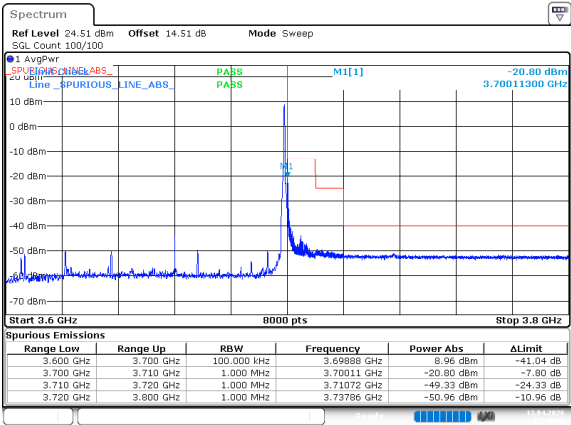


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:48:39

n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB216@0

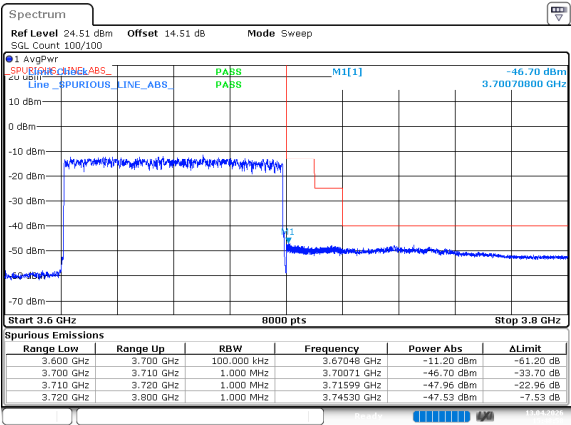


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:48:59

n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0

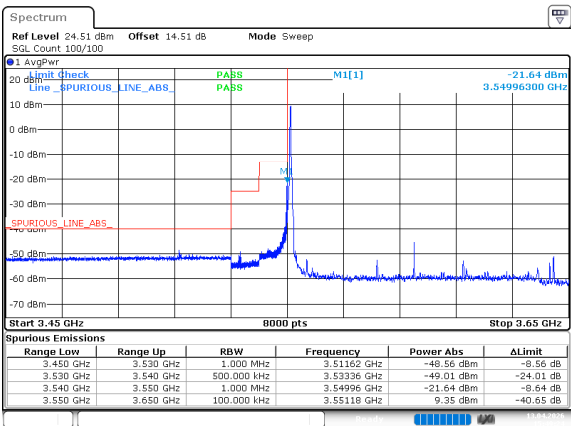

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:49:25


n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB243@0

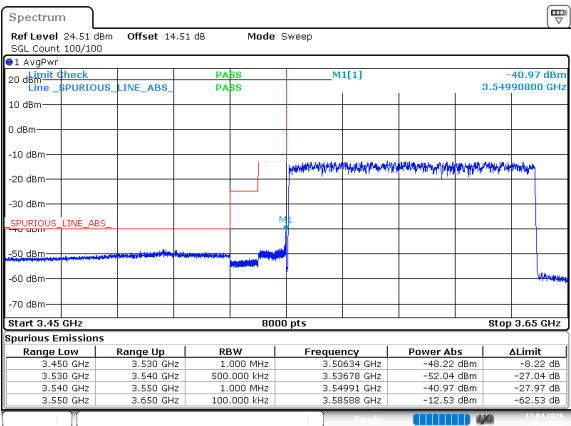

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:49:47

n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM


QPSK_RB1@244

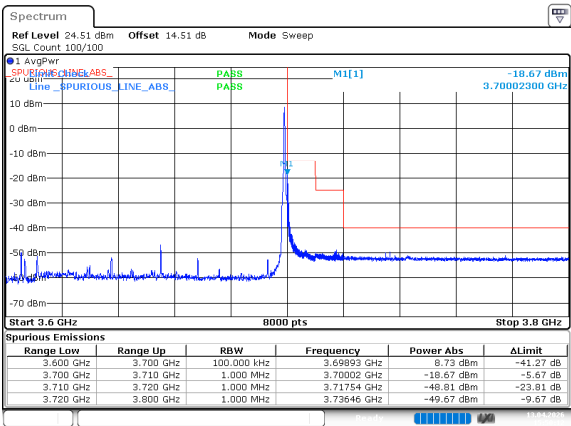

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:50:12

n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM


QPSK_RB243@0

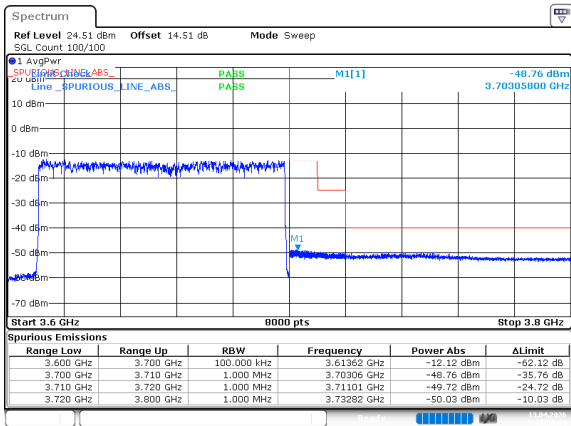

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:50:34

n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM


QPSK_RB1@0

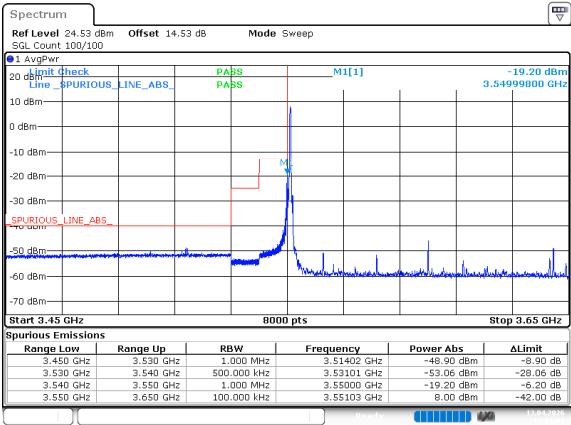

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:51:02

n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM


QPSK_RB270@0

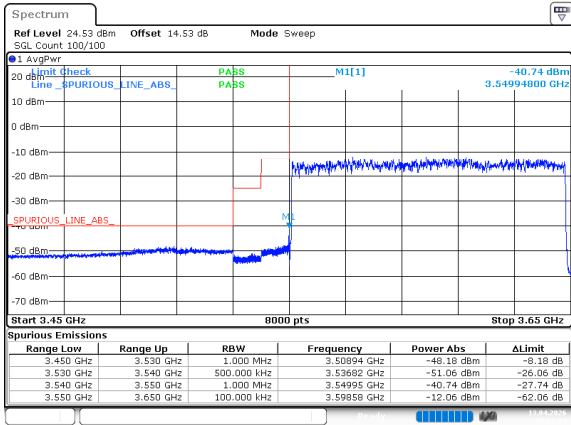

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:51:24

n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM


QPSK_RB1@272

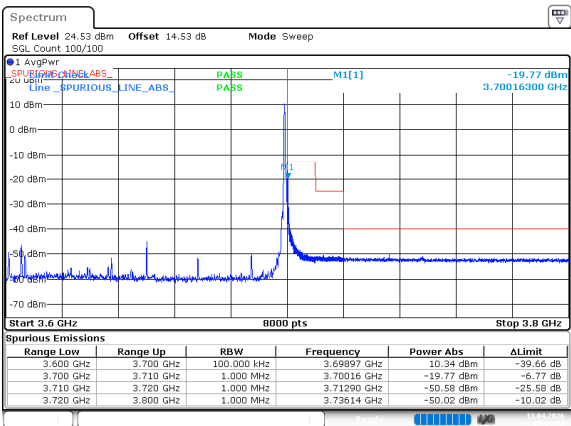

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:51:50

n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM


QPSK_RB270@0

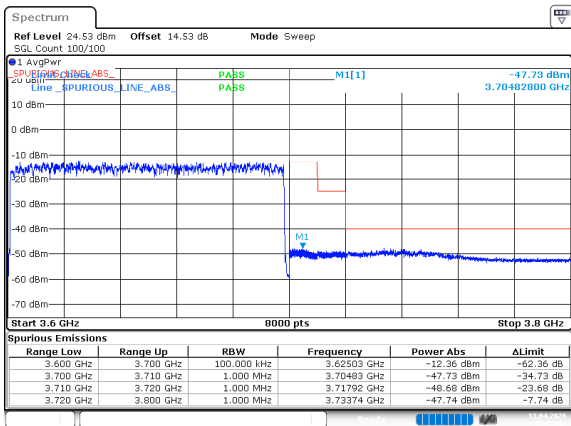

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:52:13


n78_2

n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0

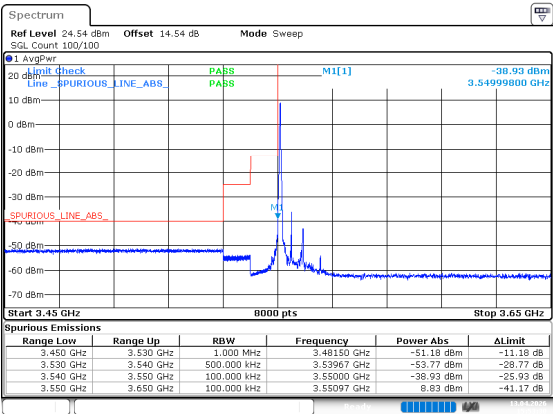


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:53:31

n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0

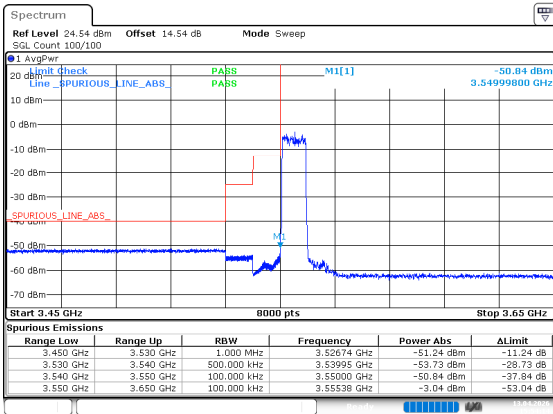


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:54:14

n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23

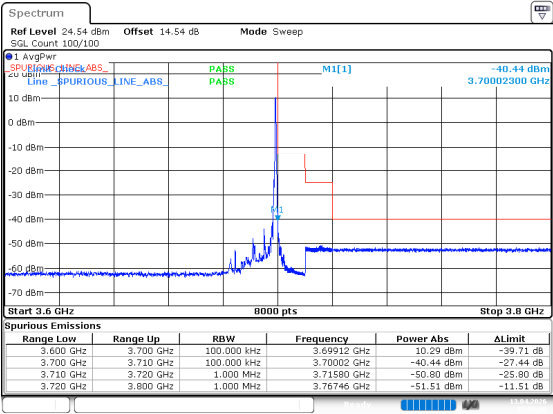


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:55:01

n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0

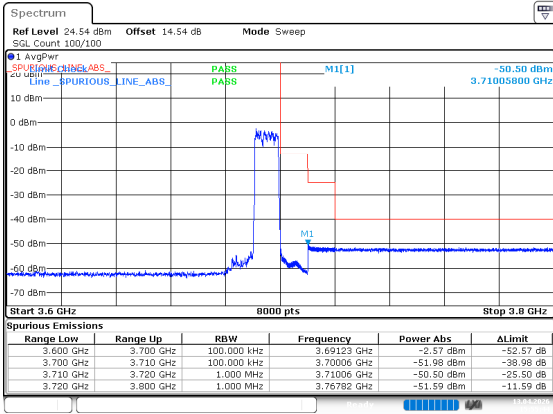


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:55:44

n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0

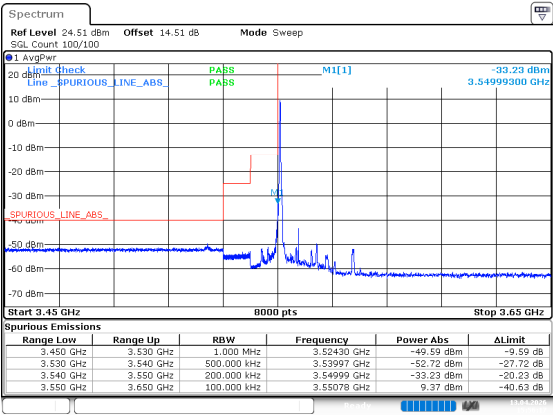

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:56:17


n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0

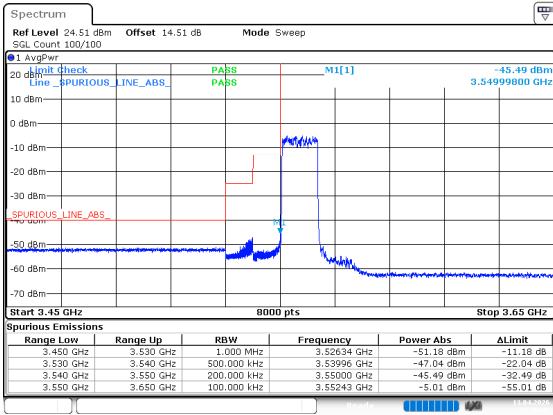

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 15:56:45


n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM

QPSK_RB1@37

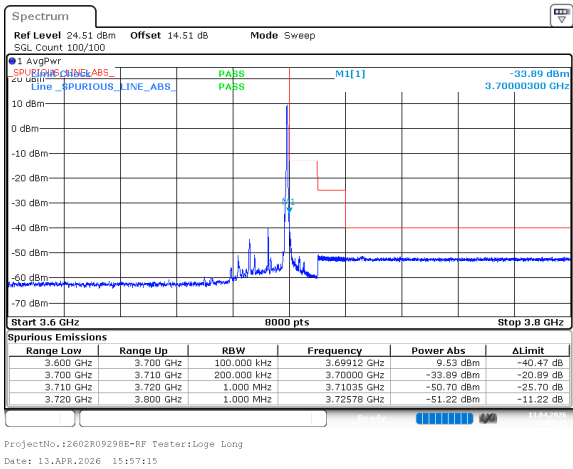


n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM


QPSK_RB36@0

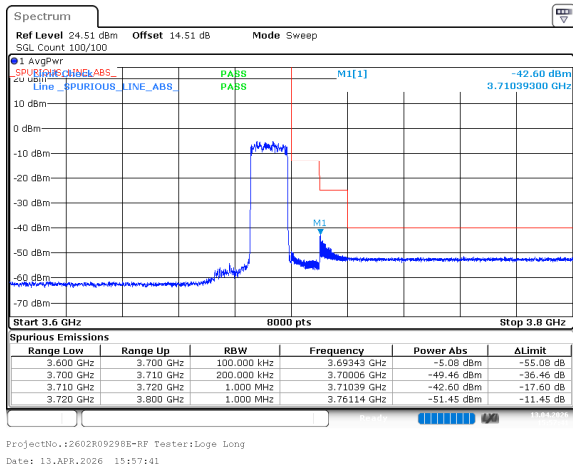


n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0

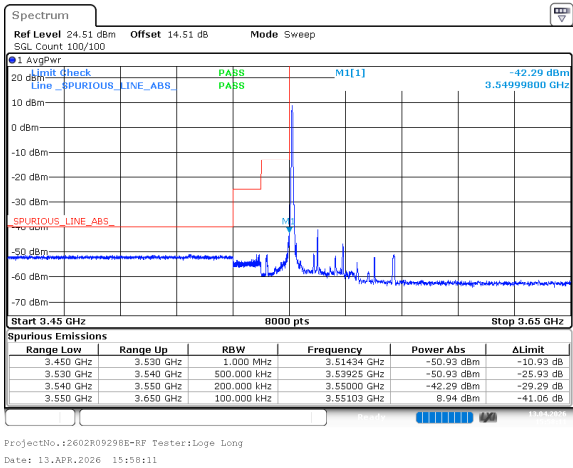


n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0

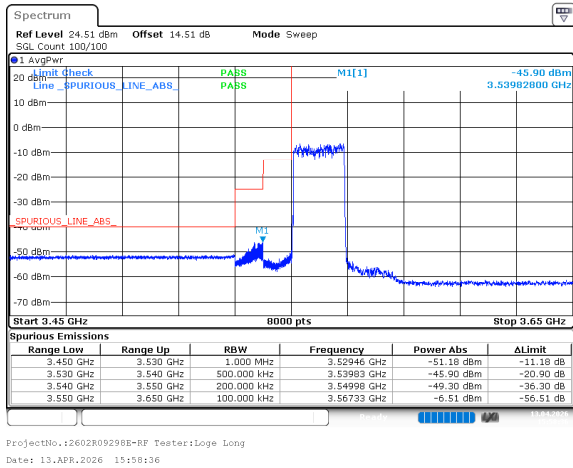

n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50

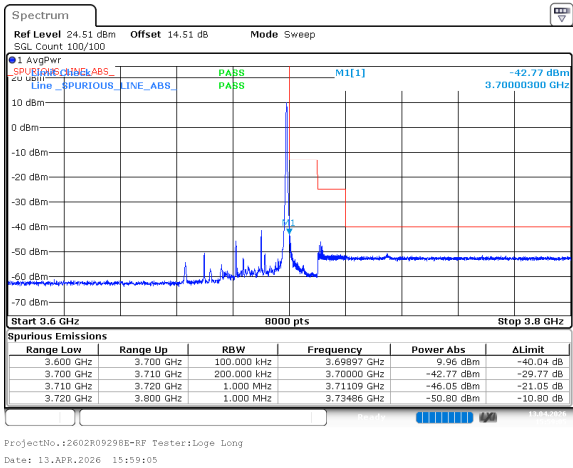


n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0

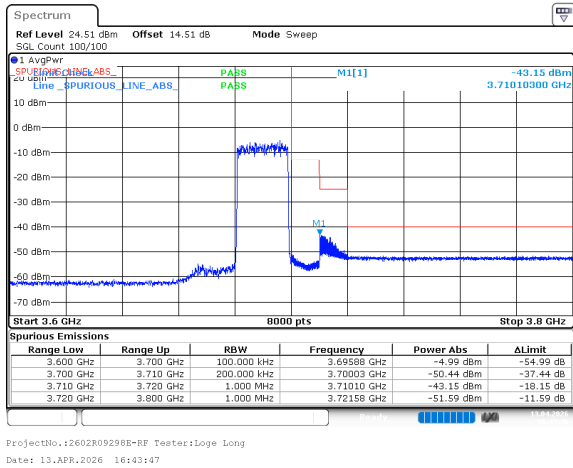

n78_2_25MHz_30kHz_3562.5MHz_DFT-s-OFDM


QPSK_RB1@0

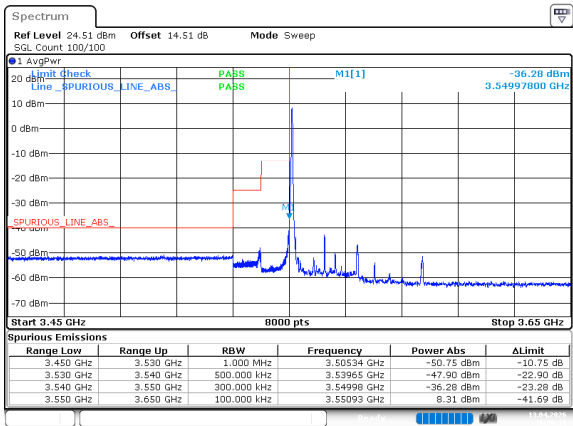

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:00:18

n78_2_25MHz_30kHz_3562.5MHz_DFT-s-OFDM


QPSK_RB64@0

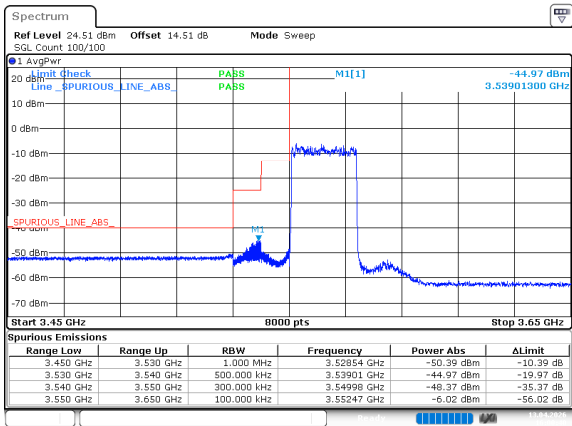

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:00:41

n78_2_25MHz_30kHz_3687.5MHz_DFT-s-OFDM


QPSK_RB1@64

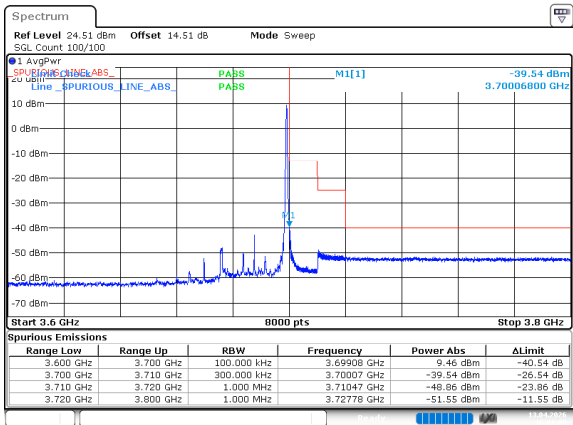

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:01:08


n78_2_25MHz_30kHz_3687.5MHz_DFT-s-OFDM

QPSK_RB64@0

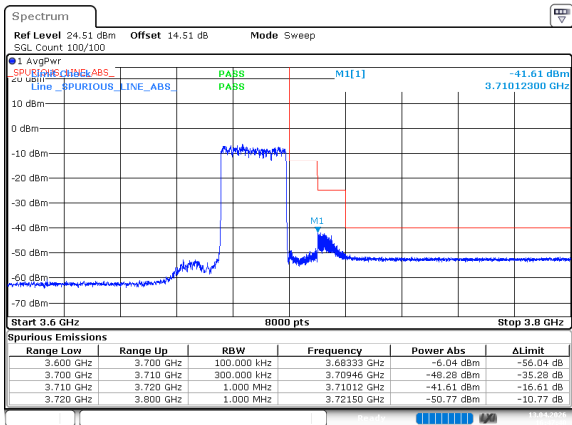


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:47:41

n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0

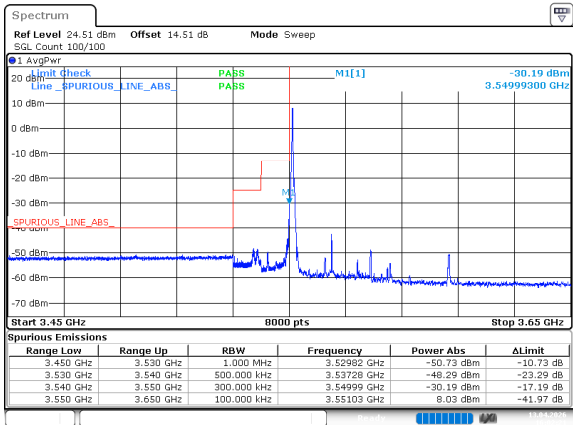

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:02:21



n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0

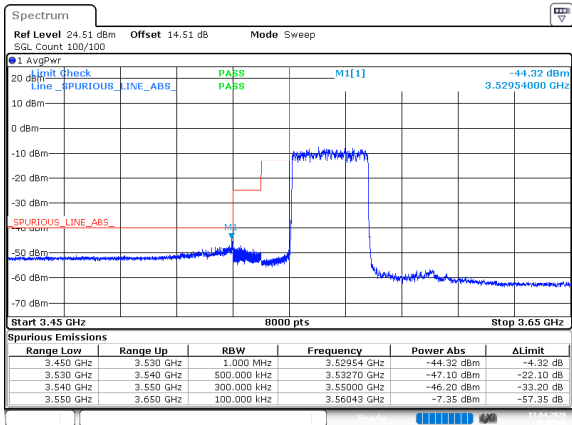


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:02:46

n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77


n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0

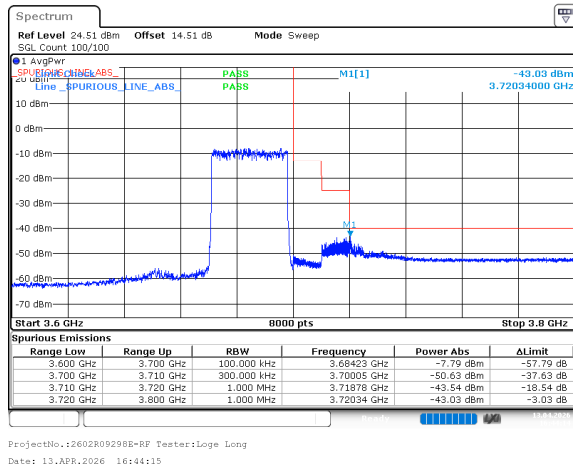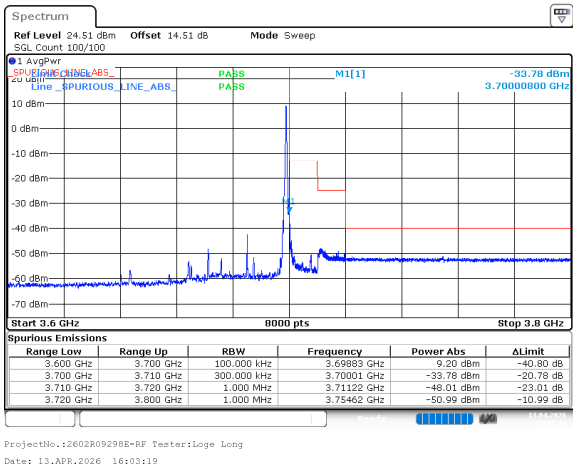


n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0

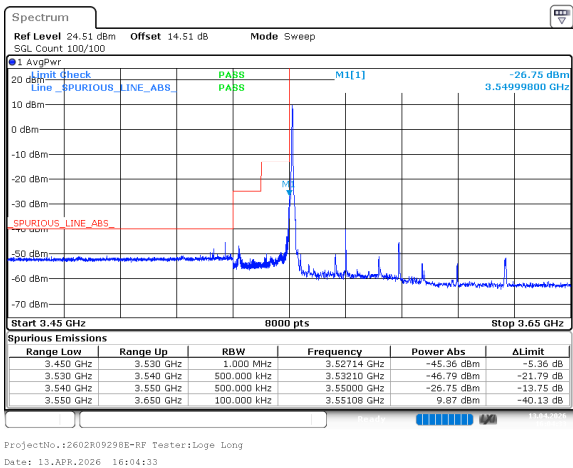


n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0

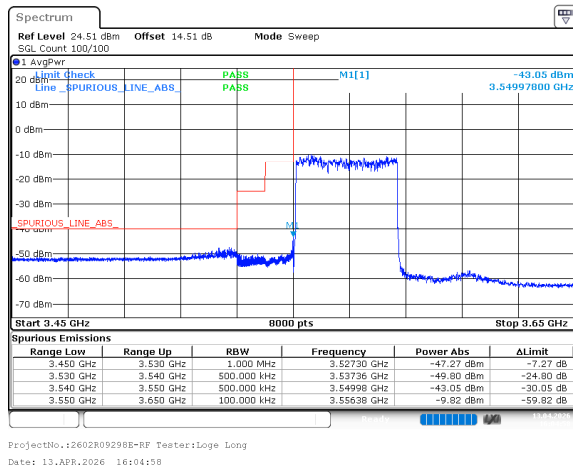


n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105

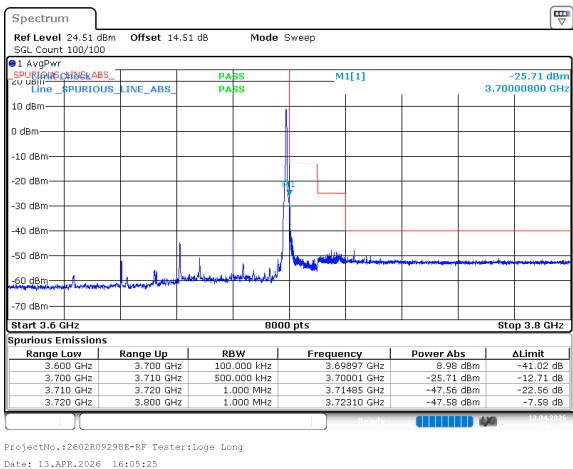

n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0

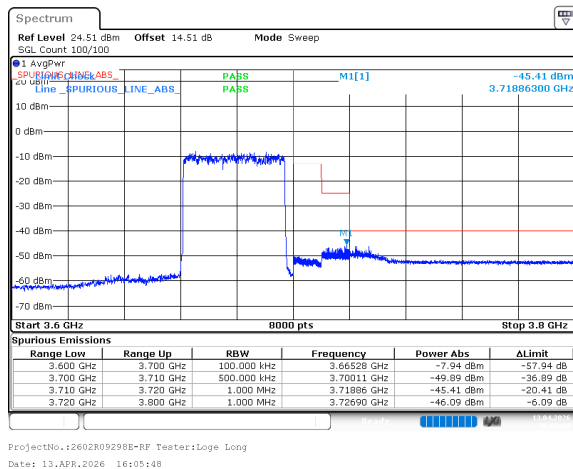


n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0

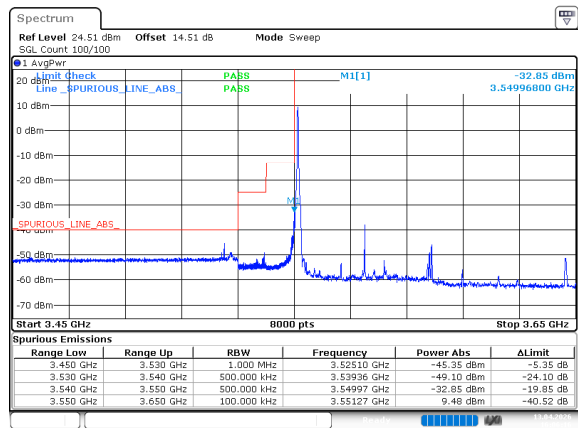


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:06:17

n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0

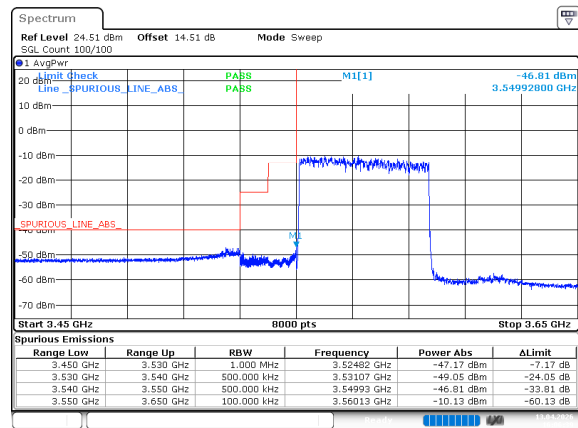


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:06:40

n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132

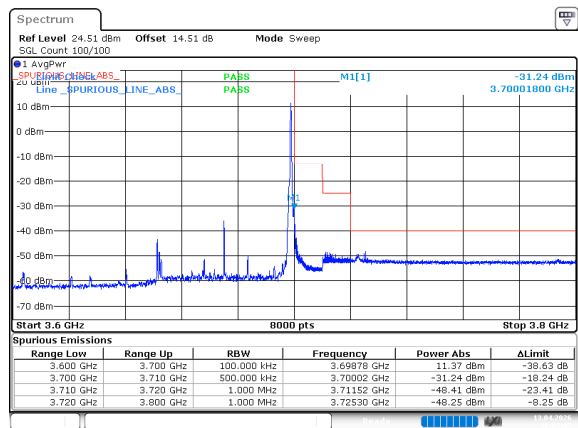


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:07:06

n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0

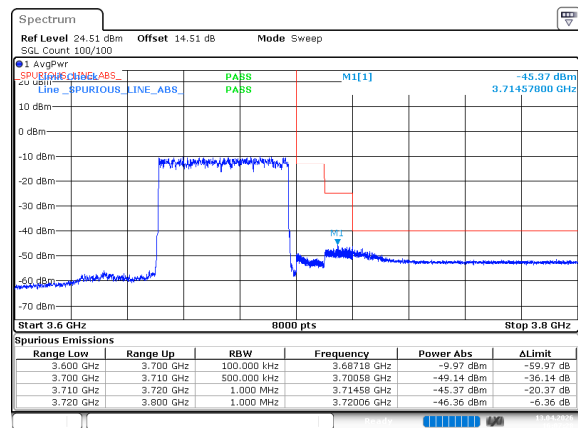


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:07:28

n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0

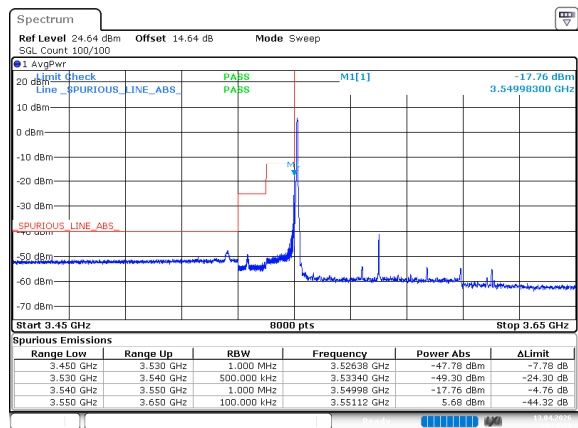

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:29:39


n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0

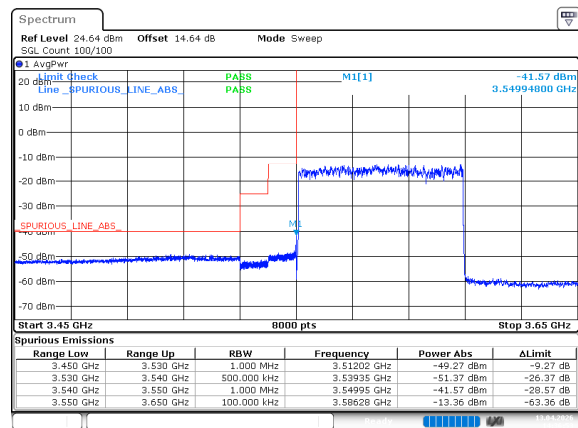

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:36:53

n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM


QPSK_RB1@161

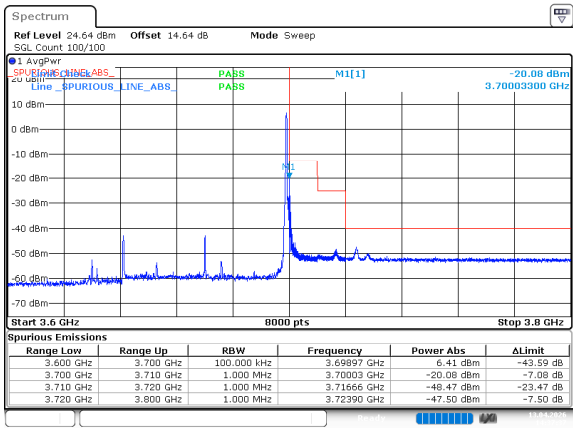

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:37:38

n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM


QPSK_RB162@0

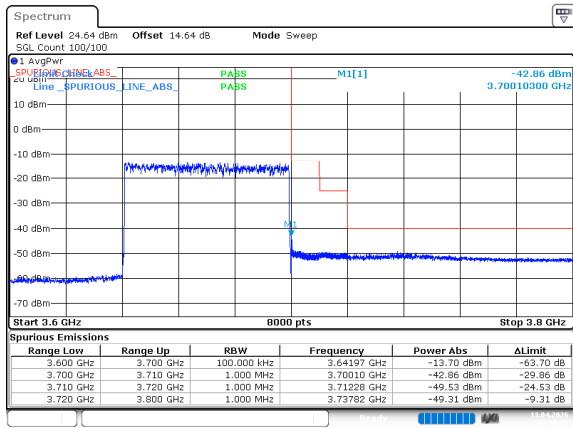

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:38:35

n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM


QPSK_RB1@0

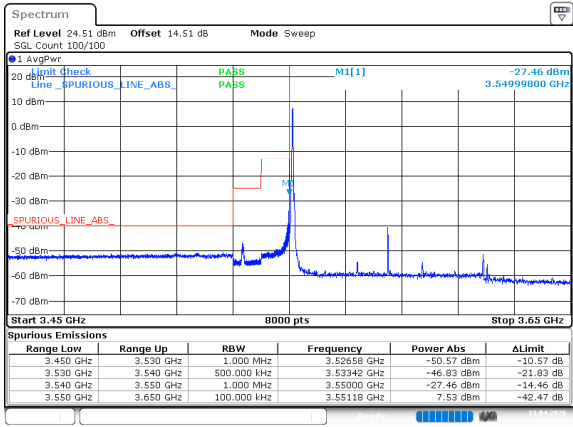

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:39:15

n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM


QPSK_RB180@0

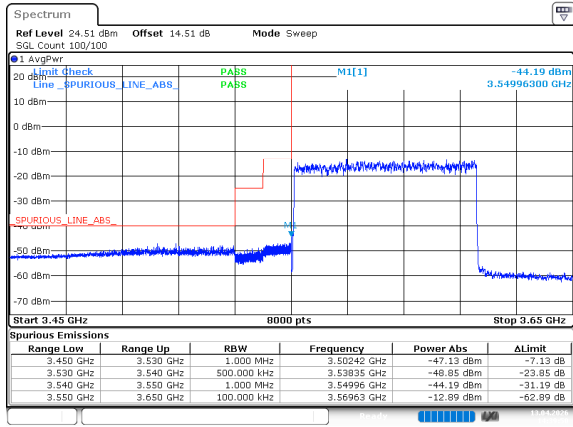

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:39:51

n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM


QPSK_RB1@188

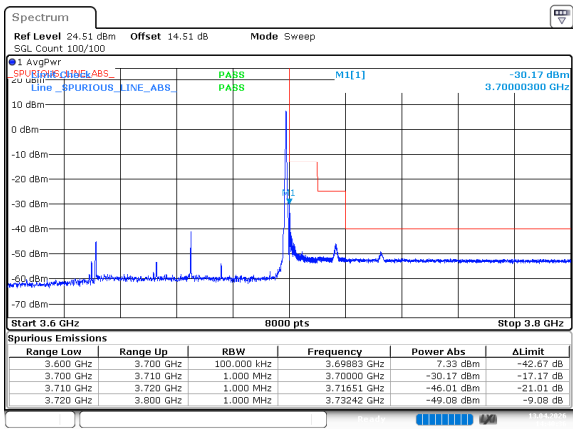

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:40:36


n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM

QPSK_RB180@0

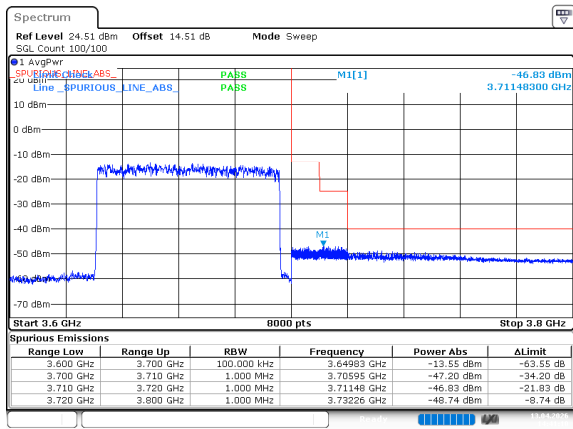


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 14:41:11

n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0

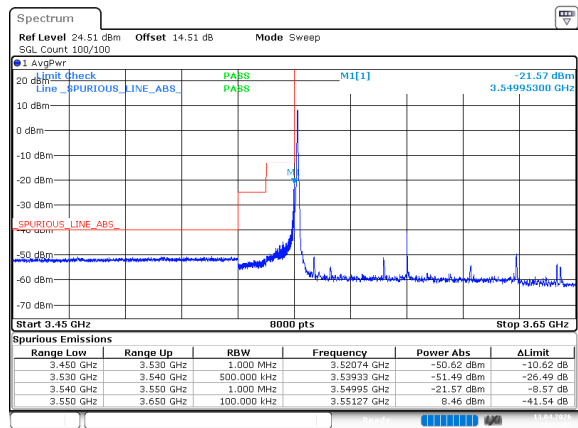


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:11:05

n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB216@0

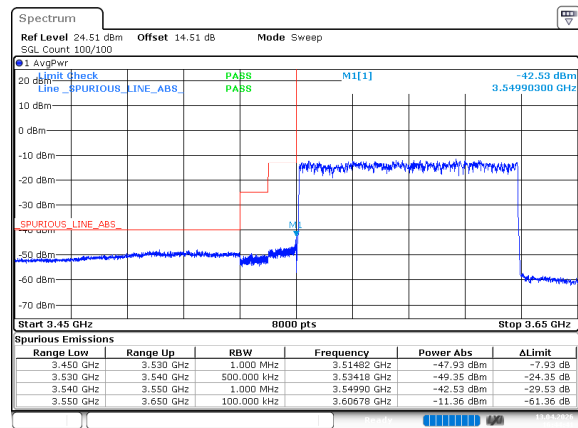


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:44:42

n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@216

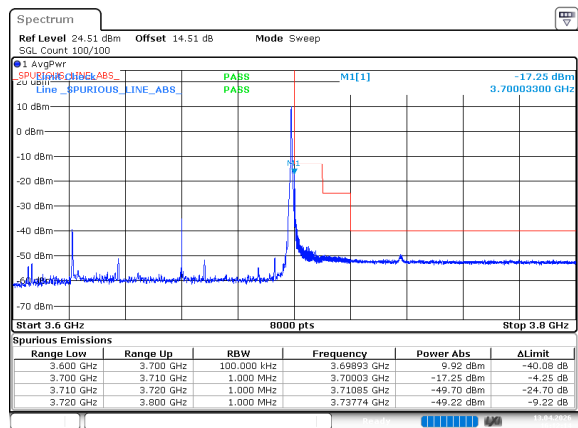


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:12:14

n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB216@0

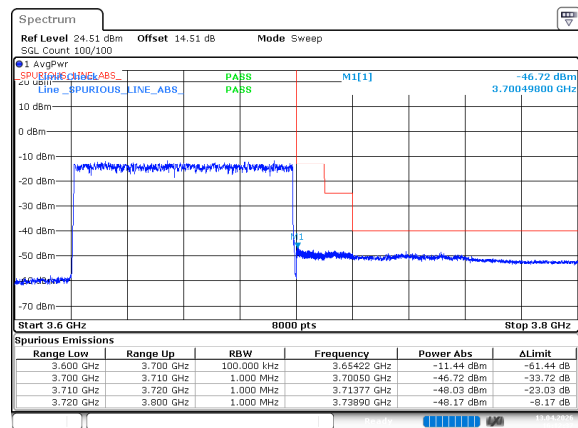


ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:12:37

n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0

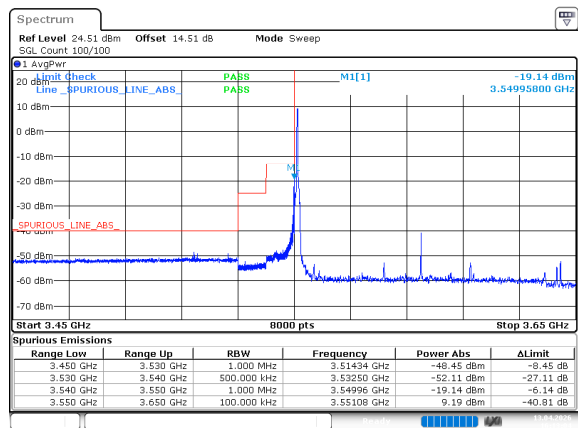

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:13:04


n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB243@0

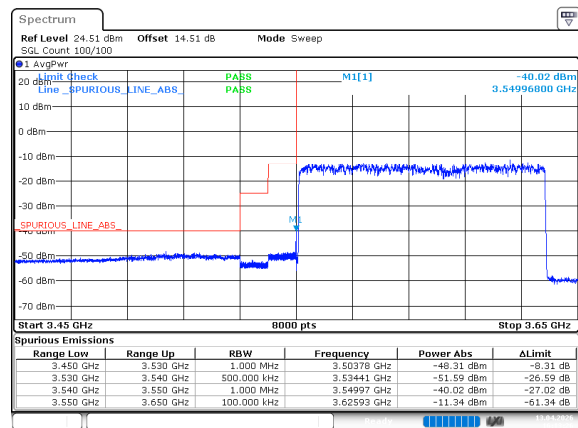

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:13:26

n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM


QPSK_RB1@244

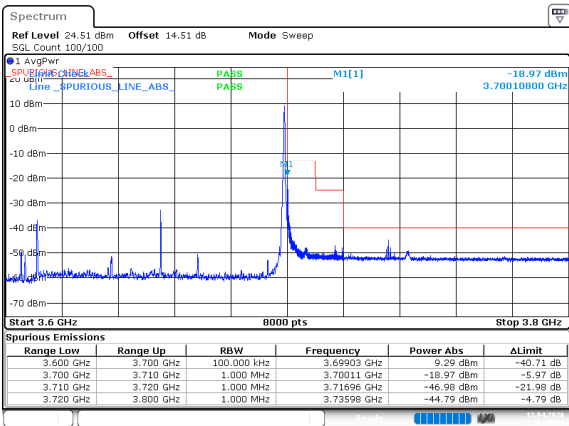

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:13:52

n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM


QPSK_RB243@0

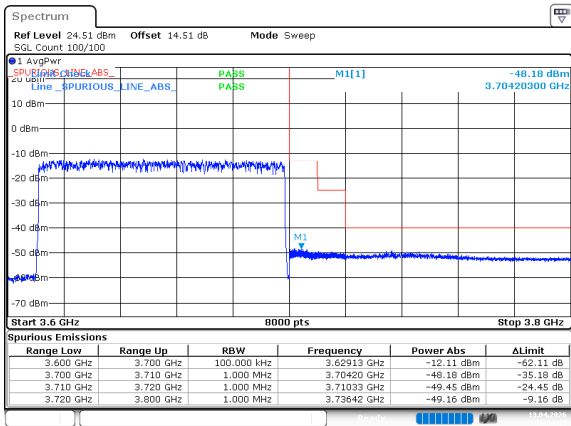

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:14:14

n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM


QPSK_RB1@0

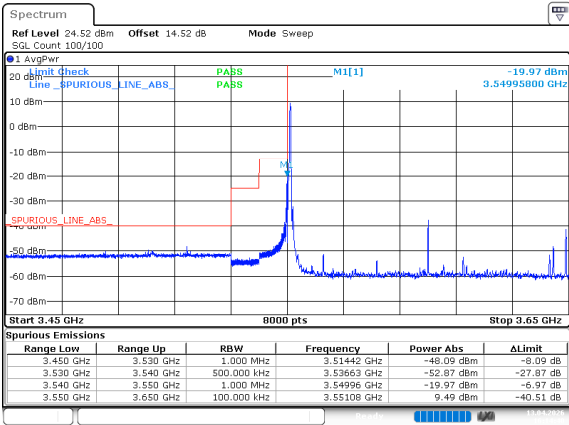

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:14:40

n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM


QPSK_RB270@0

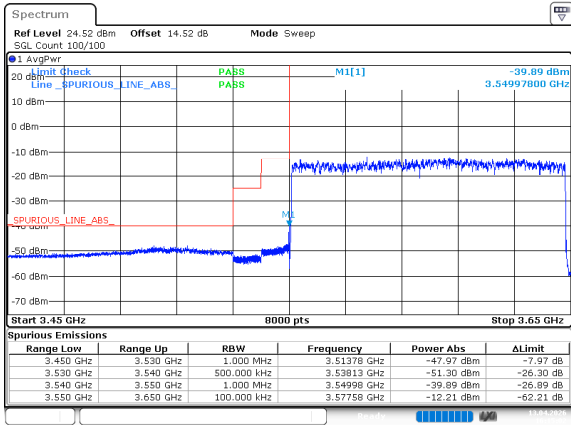

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:15:02

n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM


QPSK_RB1@272

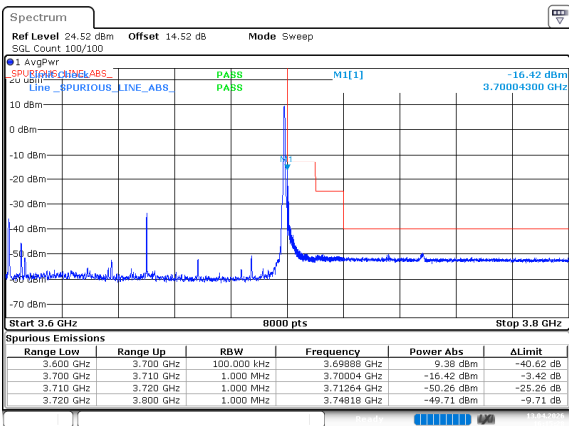

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:15:28

n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM

QPSK_RB270@0

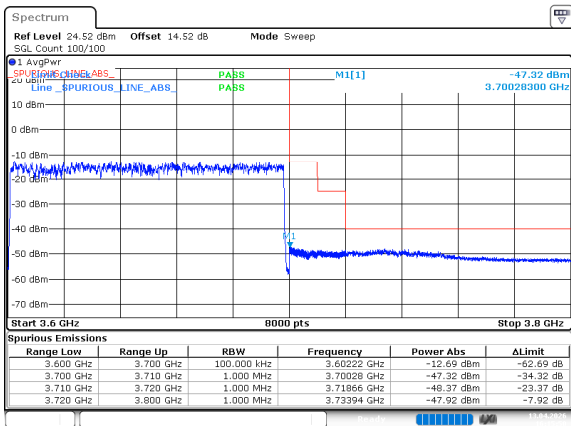

ProjectNo.:2602R09298E-RF Tester:Loge Long
Date: 13.APR.2026 16:15:50