


Appendix Test Data

Report No.:	1812C60153012501-01	Test Sample No.:	1-2-2
Start Test Date:	2026-3-19	Finish Test Date:	2026-3-26
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	24.5°C	Relative Humidity:	68%
Pressure:	101kPa		

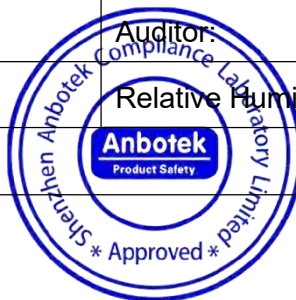

Appendix A: 20dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.960	2401.520	2402.480	---	---
DH5	Ant1	2441	0.957	2440.529	2441.486	---	---
DH5	Ant1	2480	0.936	2479.523	2480.459	---	---
2DH5	Ant1	2402	1.539	2401.223	2402.762	---	---
2DH5	Ant1	2441	1.479	2440.256	2441.735	---	---
2DH5	Ant1	2480	1.500	2479.250	2480.750	---	---
3DH5	Ant1	2402	1.491	2401.259	2402.750	---	---
3DH5	Ant1	2441	1.497	2440.259	2441.756	---	---
3DH5	Ant1	2480	1.488	2479.262	2480.750	---	---

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.88623	2401.5504	2402.4367	---	---
DH5	Ant1	2441	0.89362	2440.5492	2441.4429	---	---
DH5	Ant1	2480	0.88123	2479.5546	2480.4358	---	---
2DH5	Ant1	2402	1.3701	2401.3049	2402.6750	---	---
2DH5	Ant1	2441	1.3594	2440.3108	2441.6702	---	---
2DH5	Ant1	2480	1.3624	2479.3084	2480.6708	---	---
3DH5	Ant1	2402	1.3562	2401.3157	2402.6719	---	---
3DH5	Ant1	2441	1.3653	2440.3086	2441.6739	---	---
3DH5	Ant1	2480	1.3824	2479.3017	2480.6841	---	---

Test Graphs




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



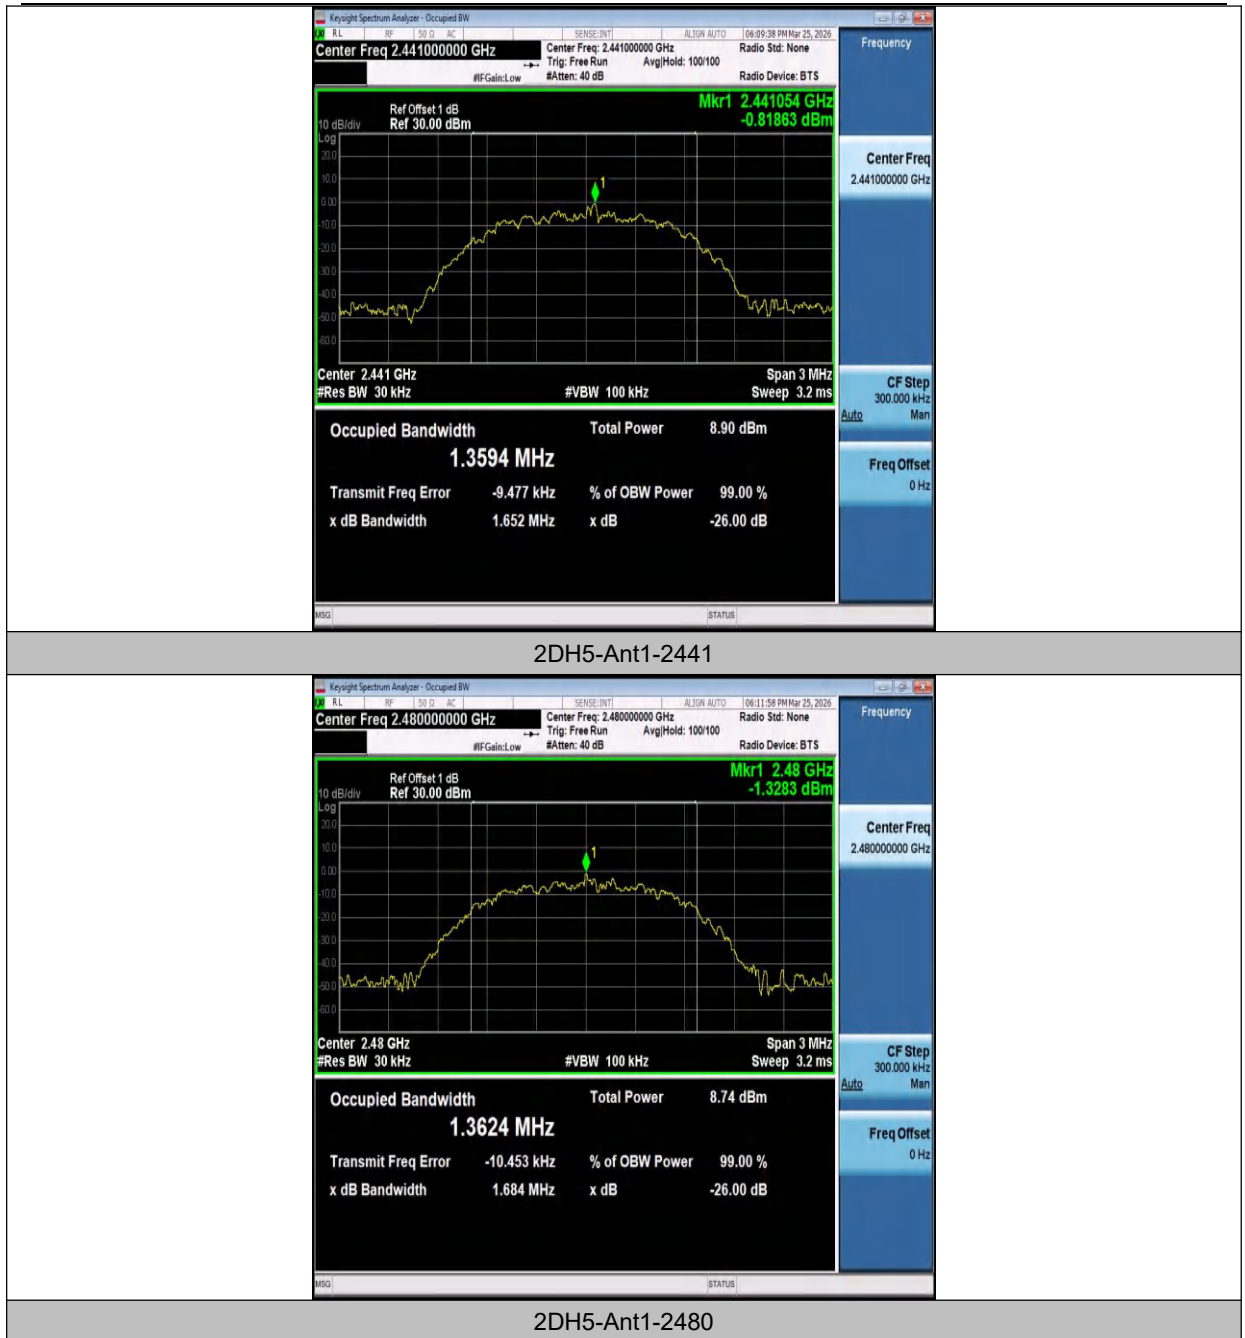

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

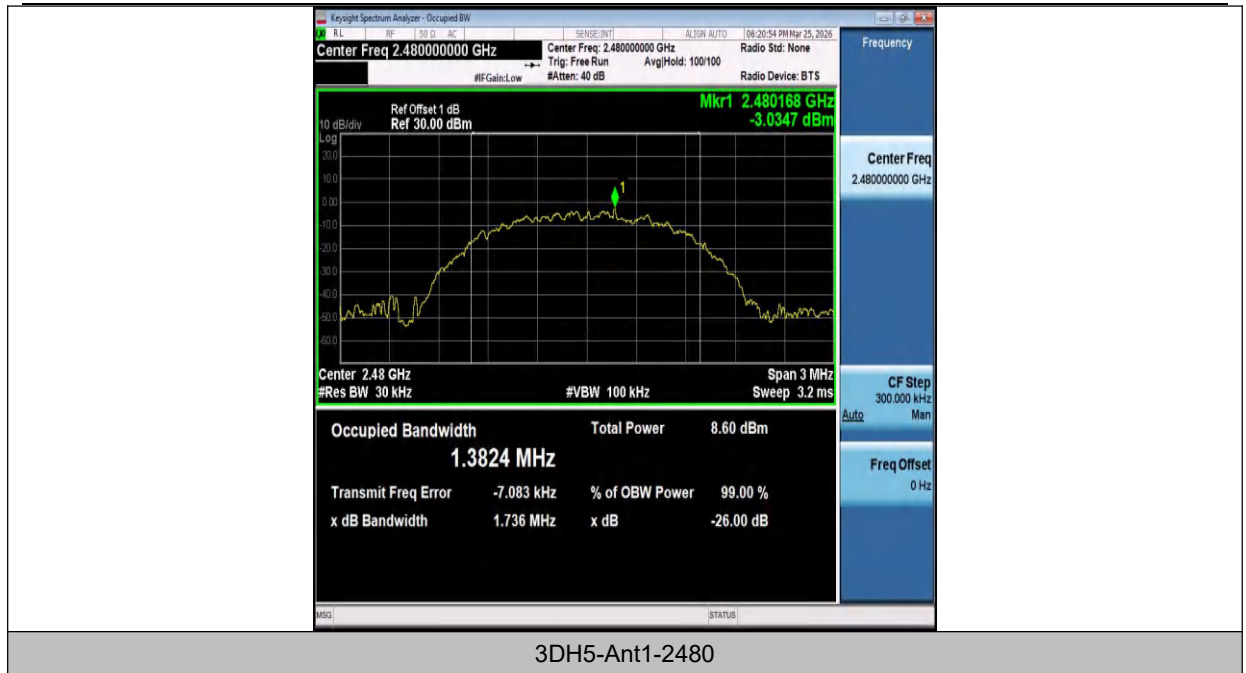

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: Maximum Conducted Output Power

Test Result Peak

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	1.08	≤20.97	PASS
DH5	Ant1	2441	1.70	≤20.97	PASS
DH5	Ant1	2480	1.63	≤20.97	PASS
2DH5	Ant1	2402	3.42	≤20.97	PASS
2DH5	Ant1	2441	3.83	≤20.97	PASS
2DH5	Ant1	2480	3.77	≤20.97	PASS
3DH5	Ant1	2402	3.57	≤20.97	PASS
3DH5	Ant1	2441	4.01	≤20.97	PASS
3DH5	Ant1	2480	4.01	≤20.97	PASS


Test Graphs

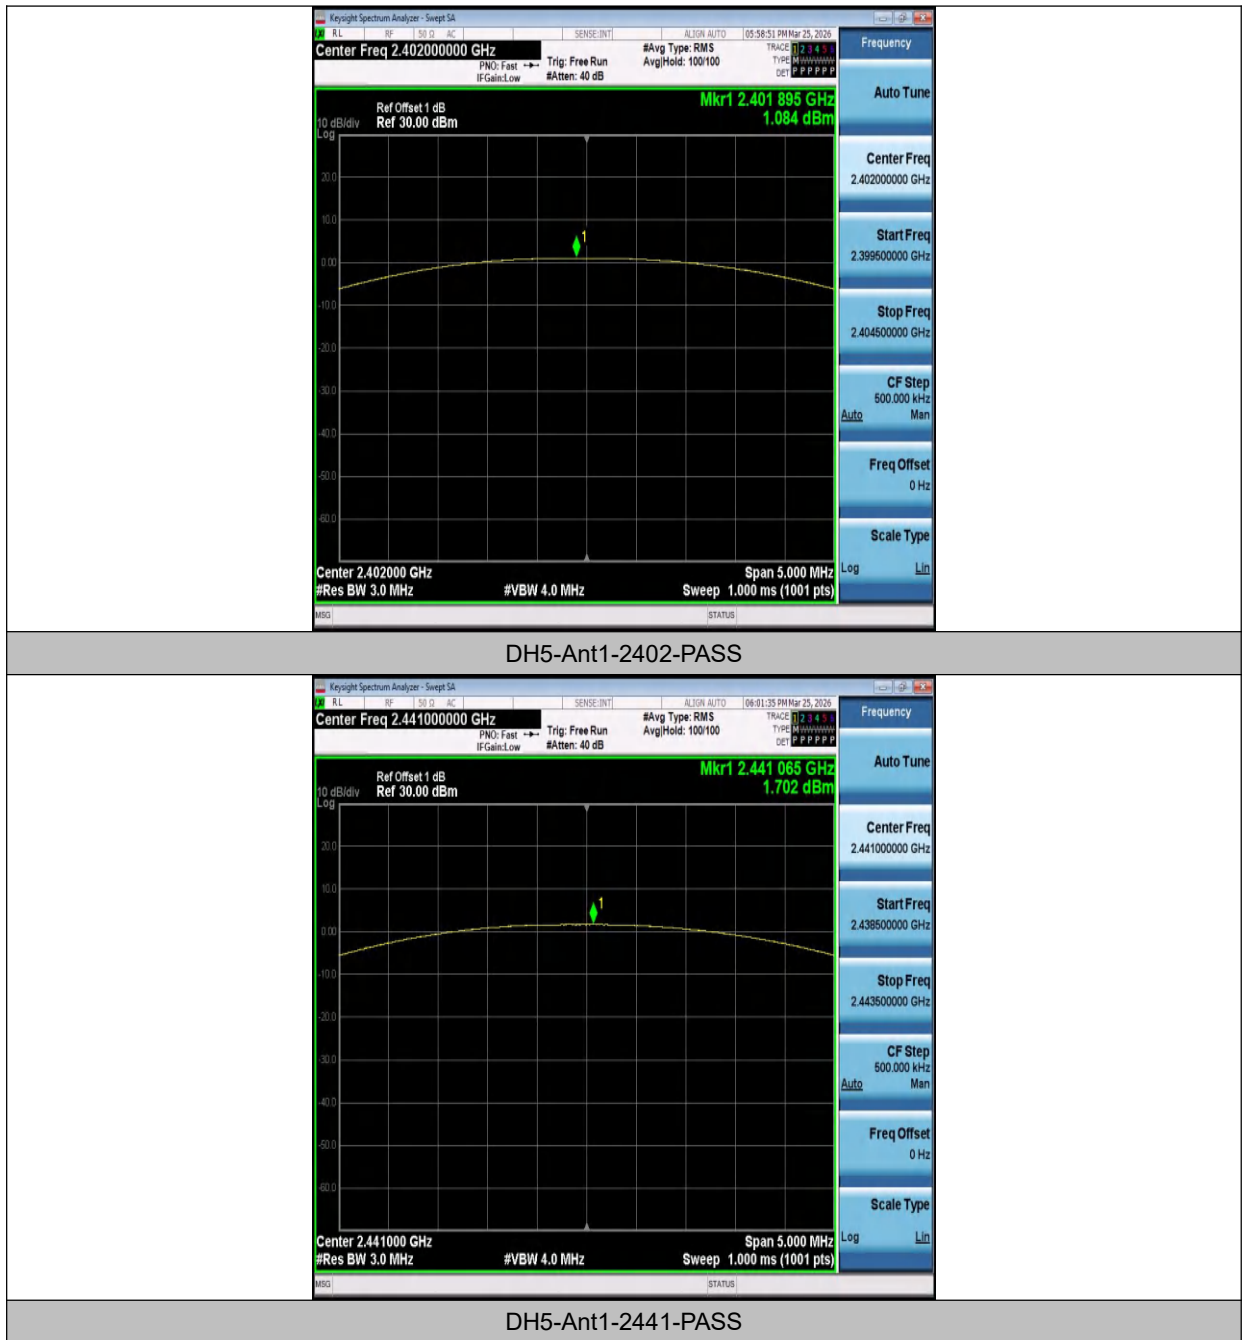

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

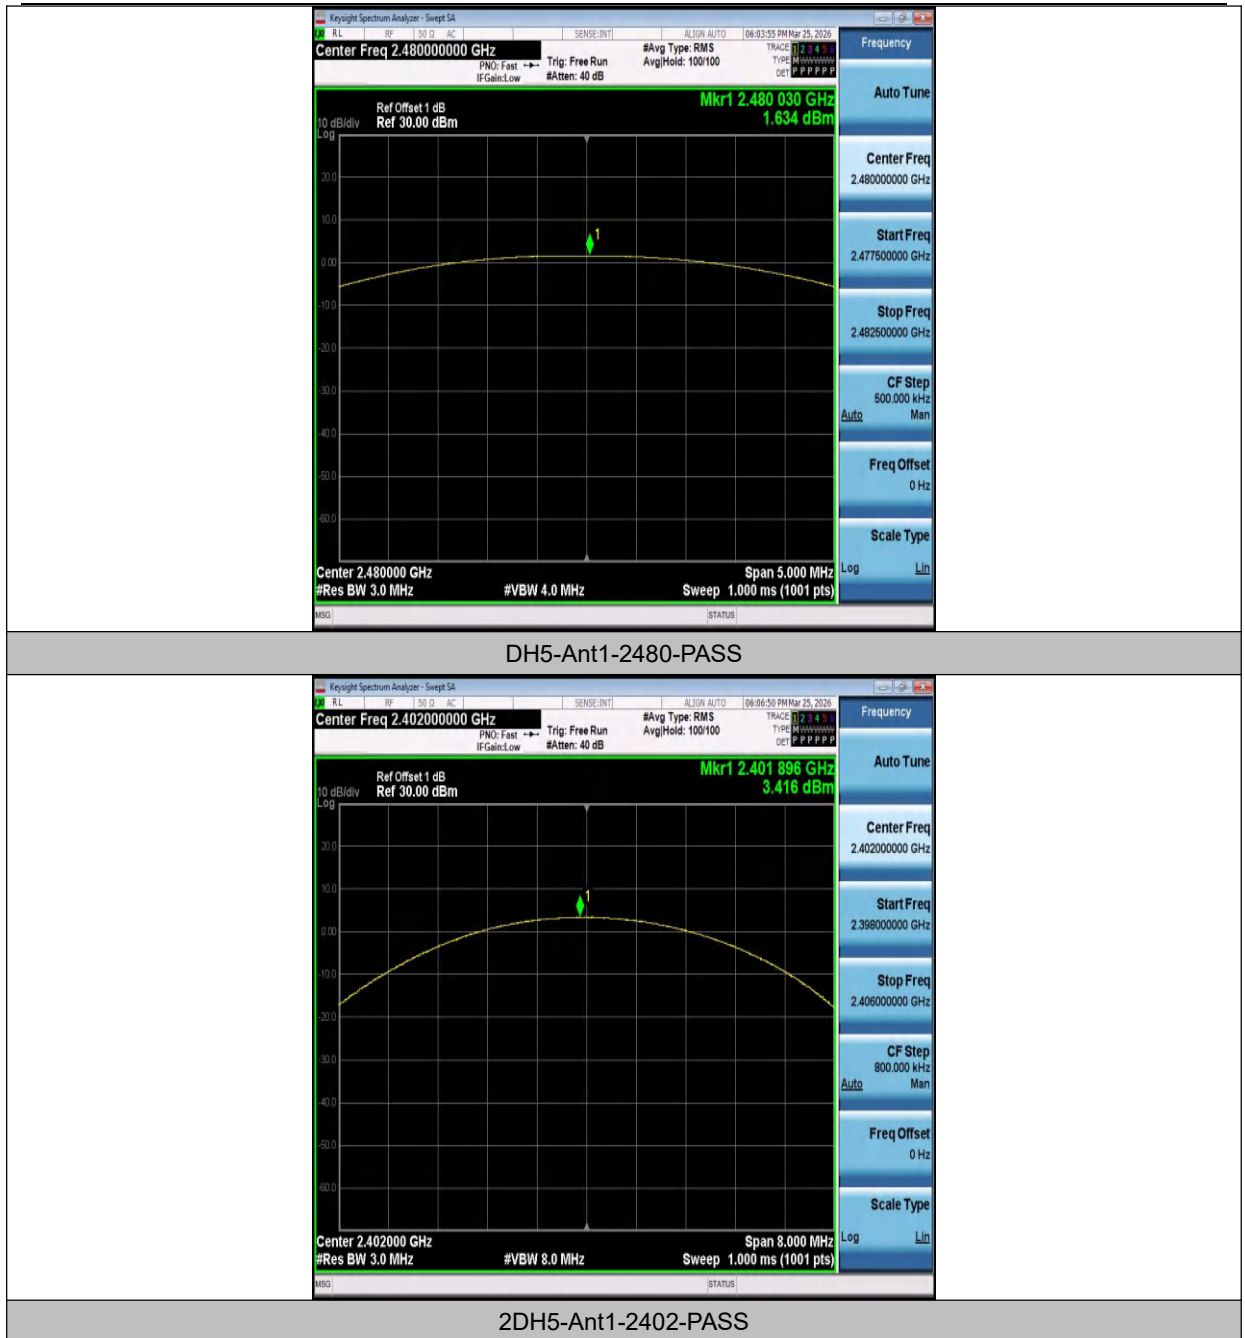

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

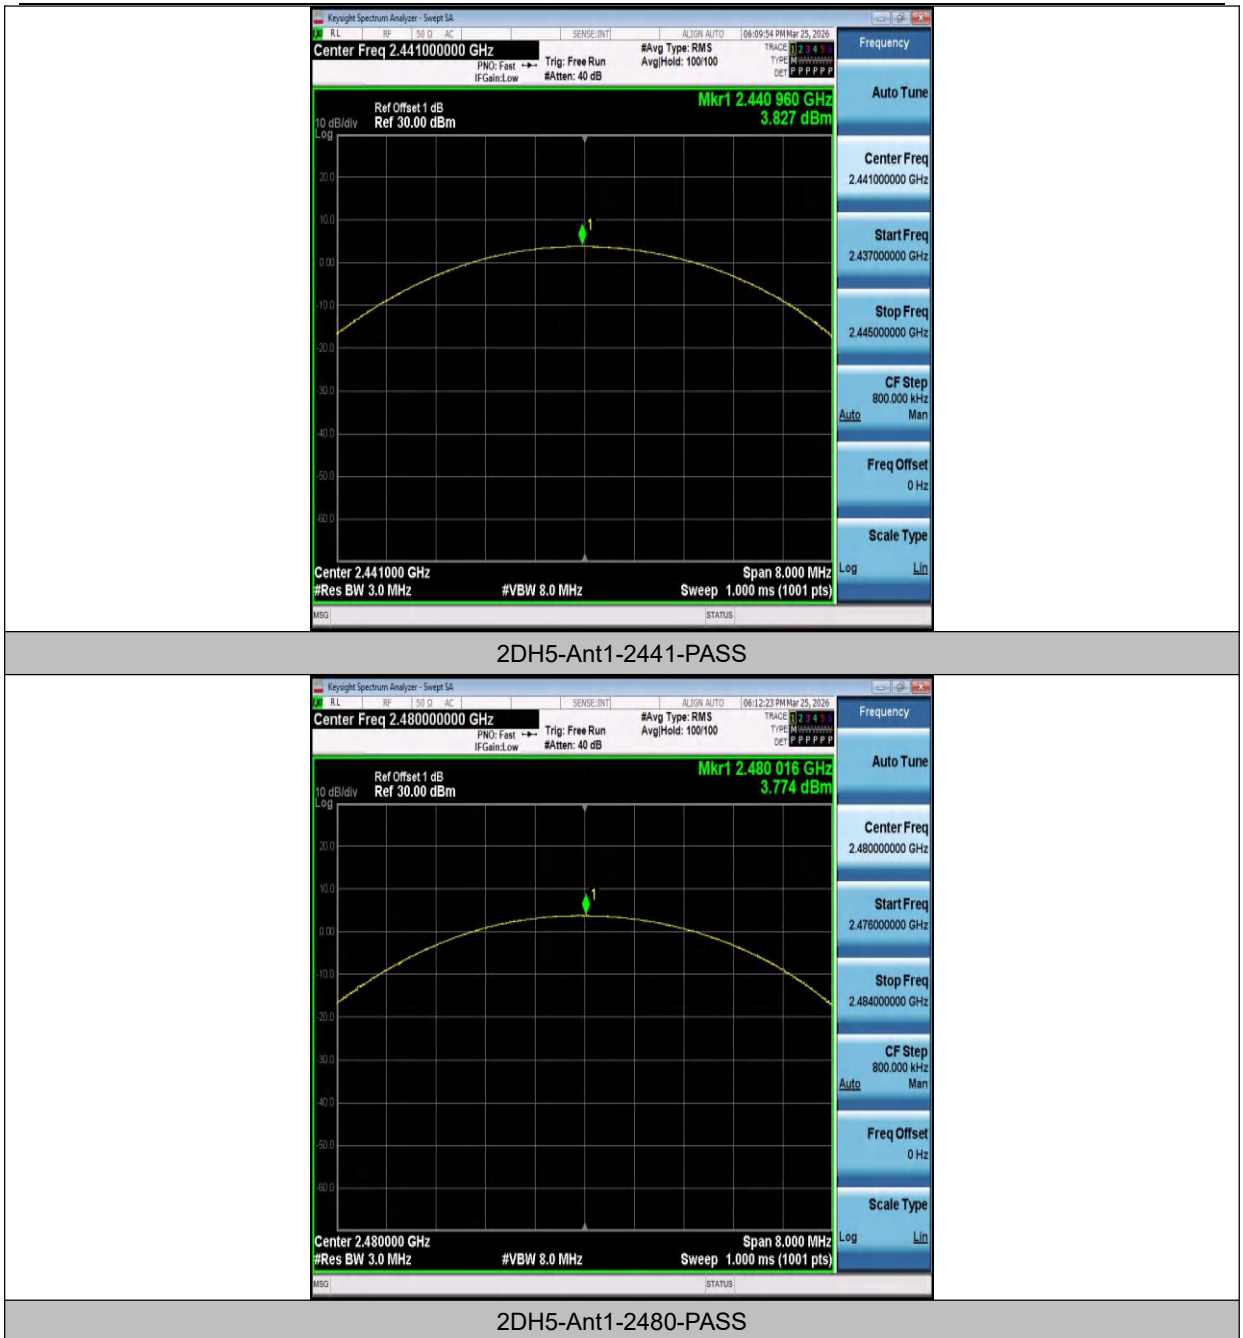

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

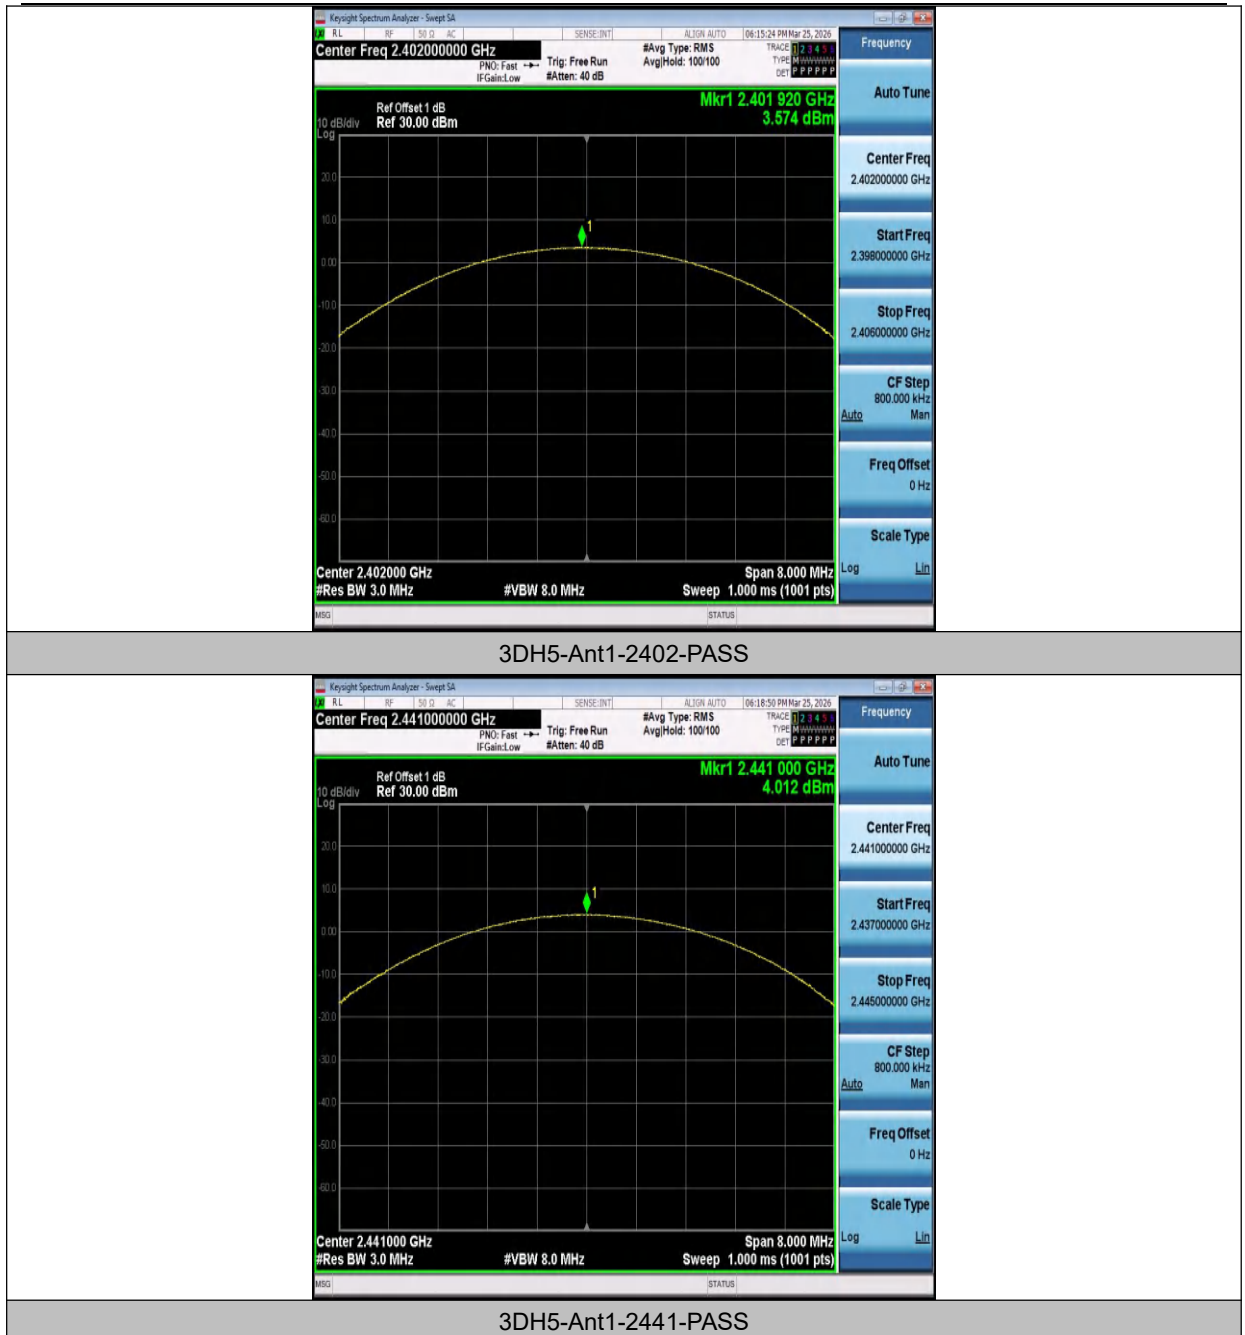

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

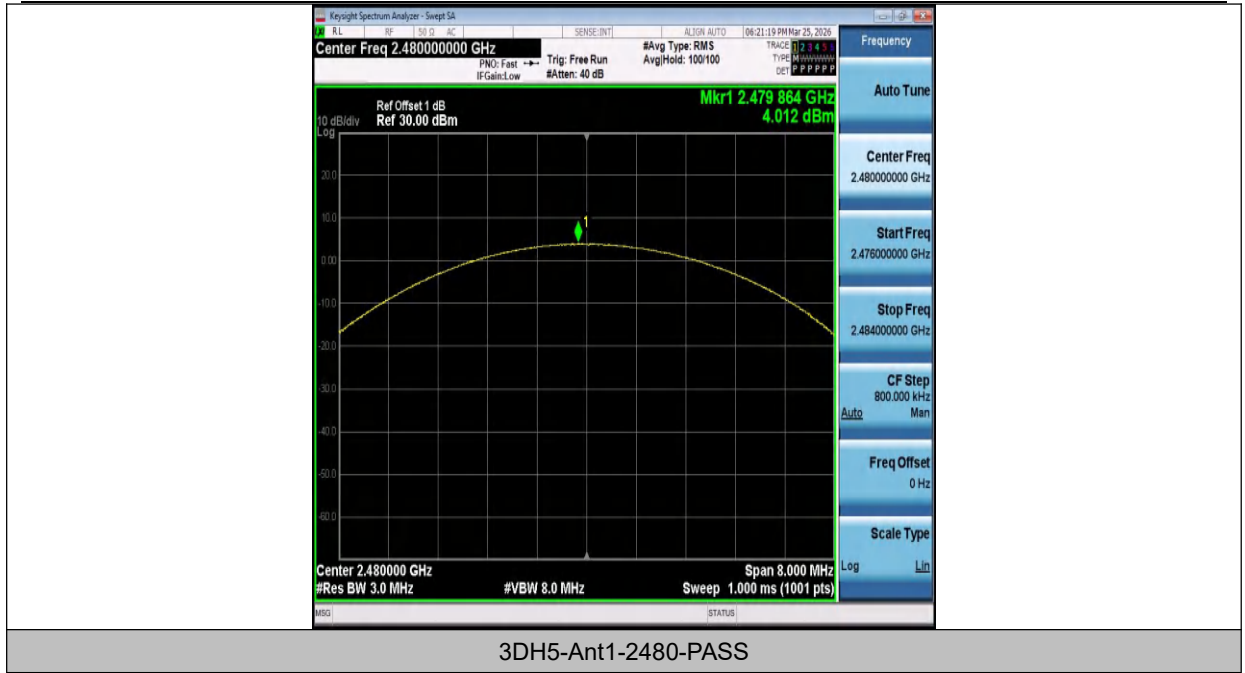

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Carrier frequency separation

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	0.69	≥ 0.640	PASS
2DH5	Ant1	Hop	1.292	≥ 1.026	PASS
3DH5	Ant1	Hop	1.178	≥ 0.998	PASS

Note: For conducted power less than 0.125 W(20.97 dBm), the limit can be set using hopping channel carrier frequencies that are separated by 25 kHz or two thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Dwell Time

Test Result

Test Mode	Antenna	Frequency [MHz]	Burst Width [ms]	Total Hops [Num]	Result [s]	Limit [s]	Verdict
DH5	Ant1	Hop	2.883	112	0.323	≤0.4	PASS
2DH5	Ant1	Hop	2.888	92	0.266	≤0.4	PASS
3DH5	Ant1	Hop	2.889	93	0.269	≤0.4	PASS


Test Graphs

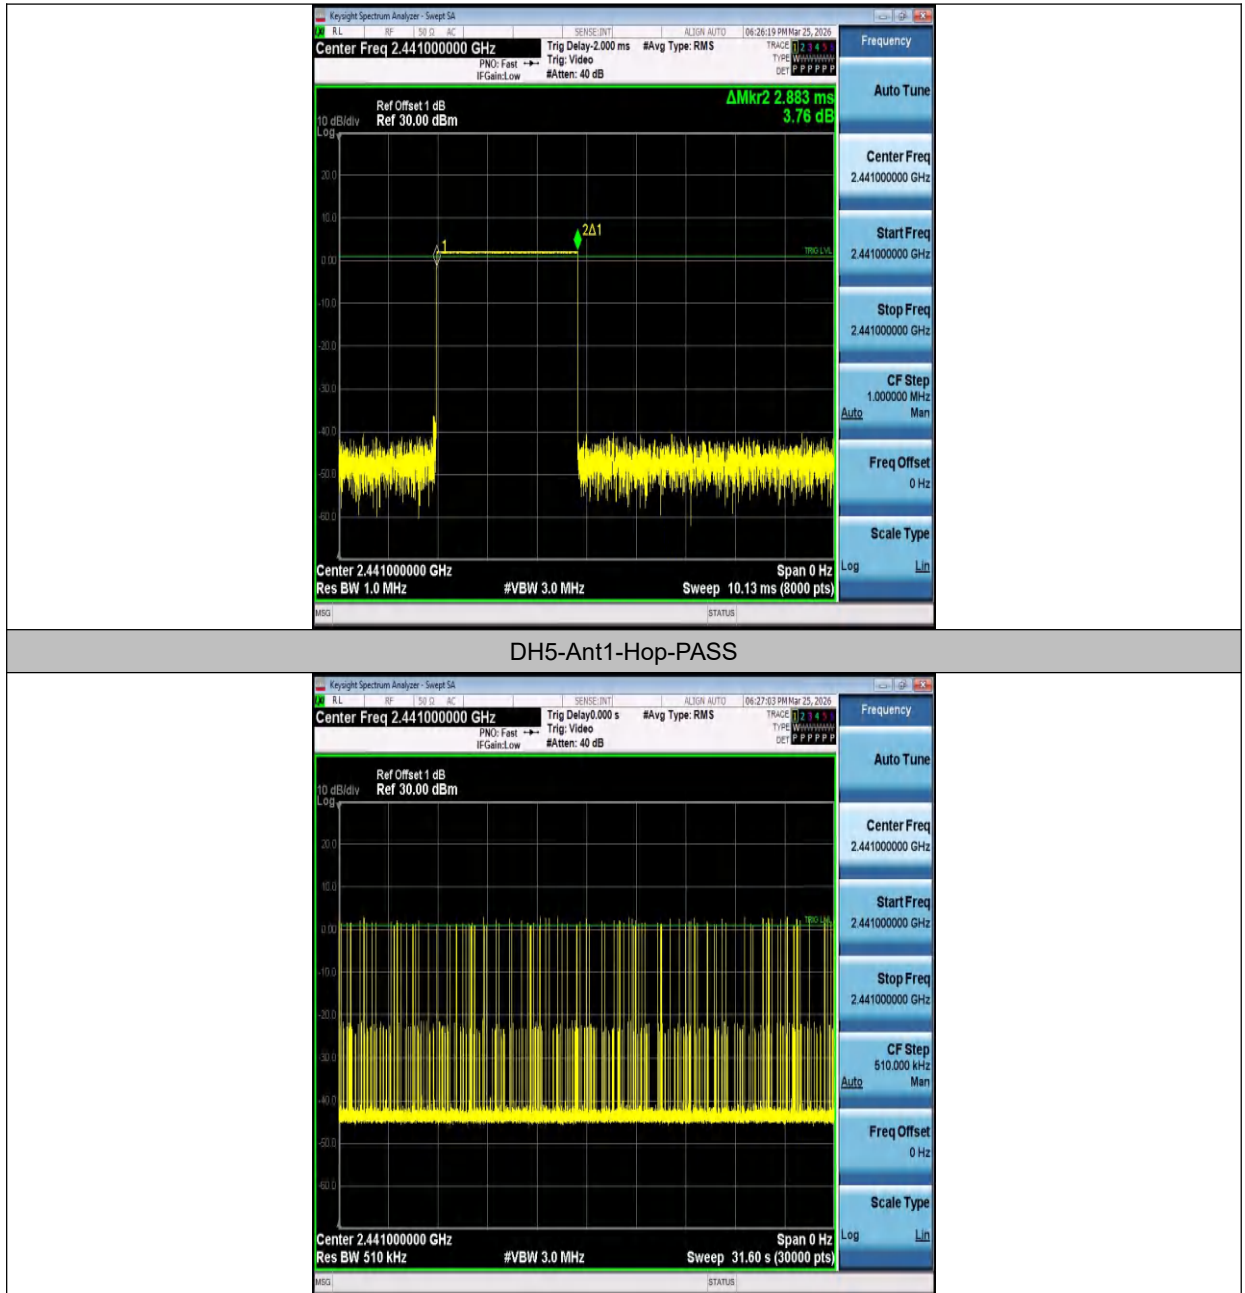

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

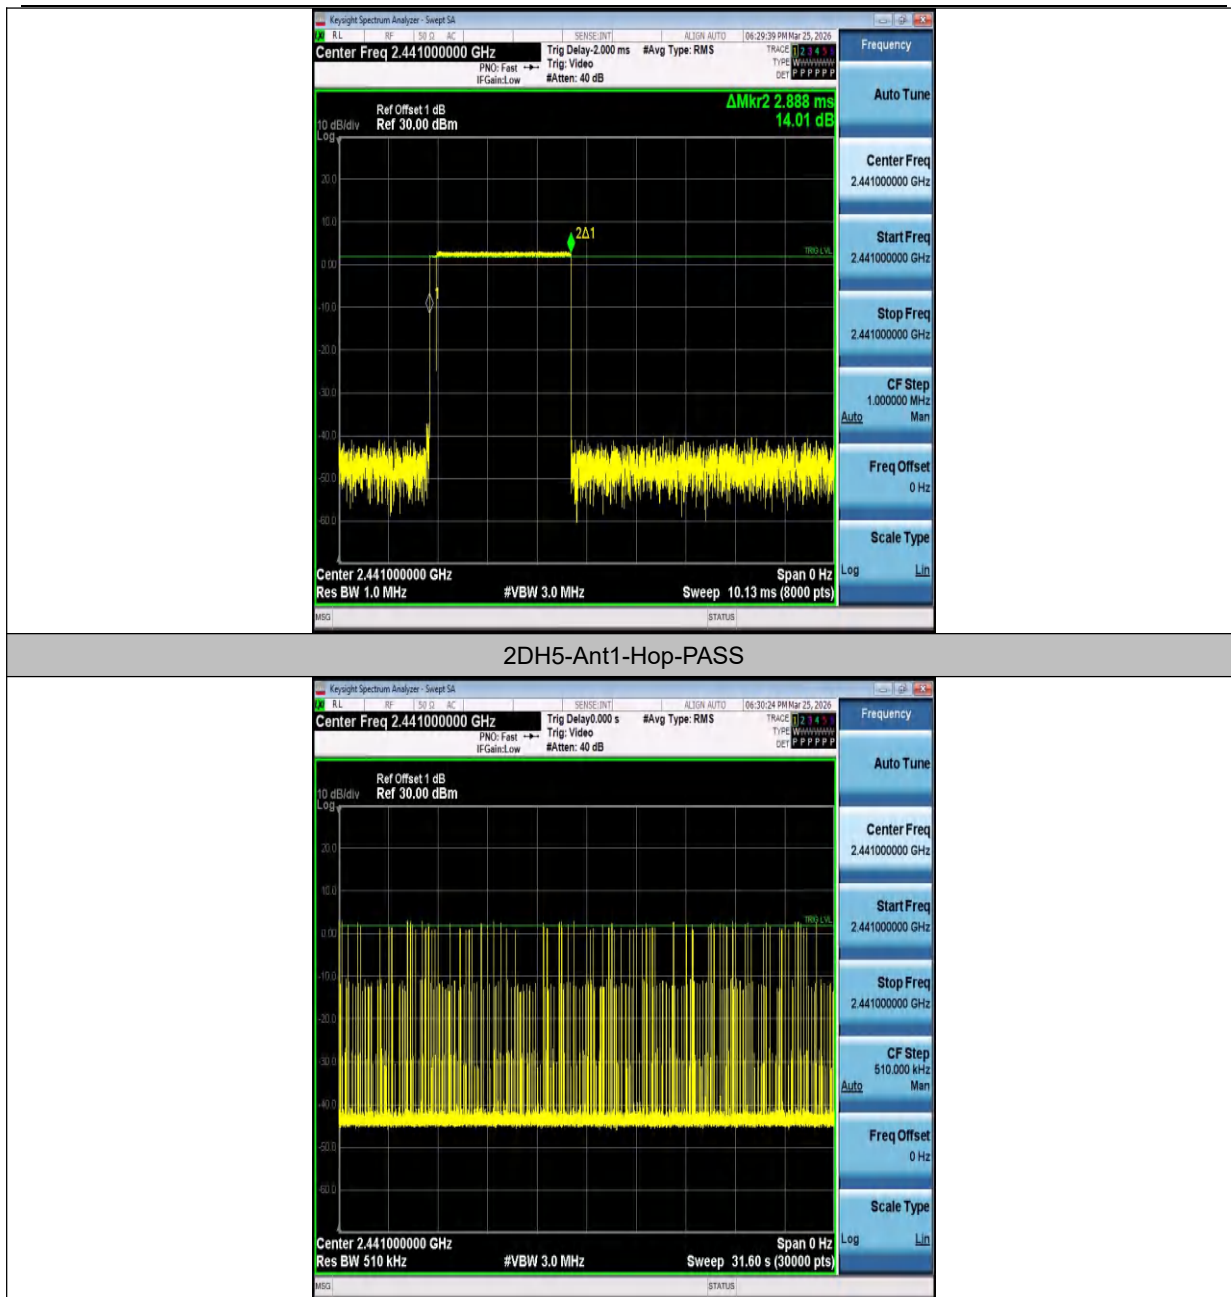

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

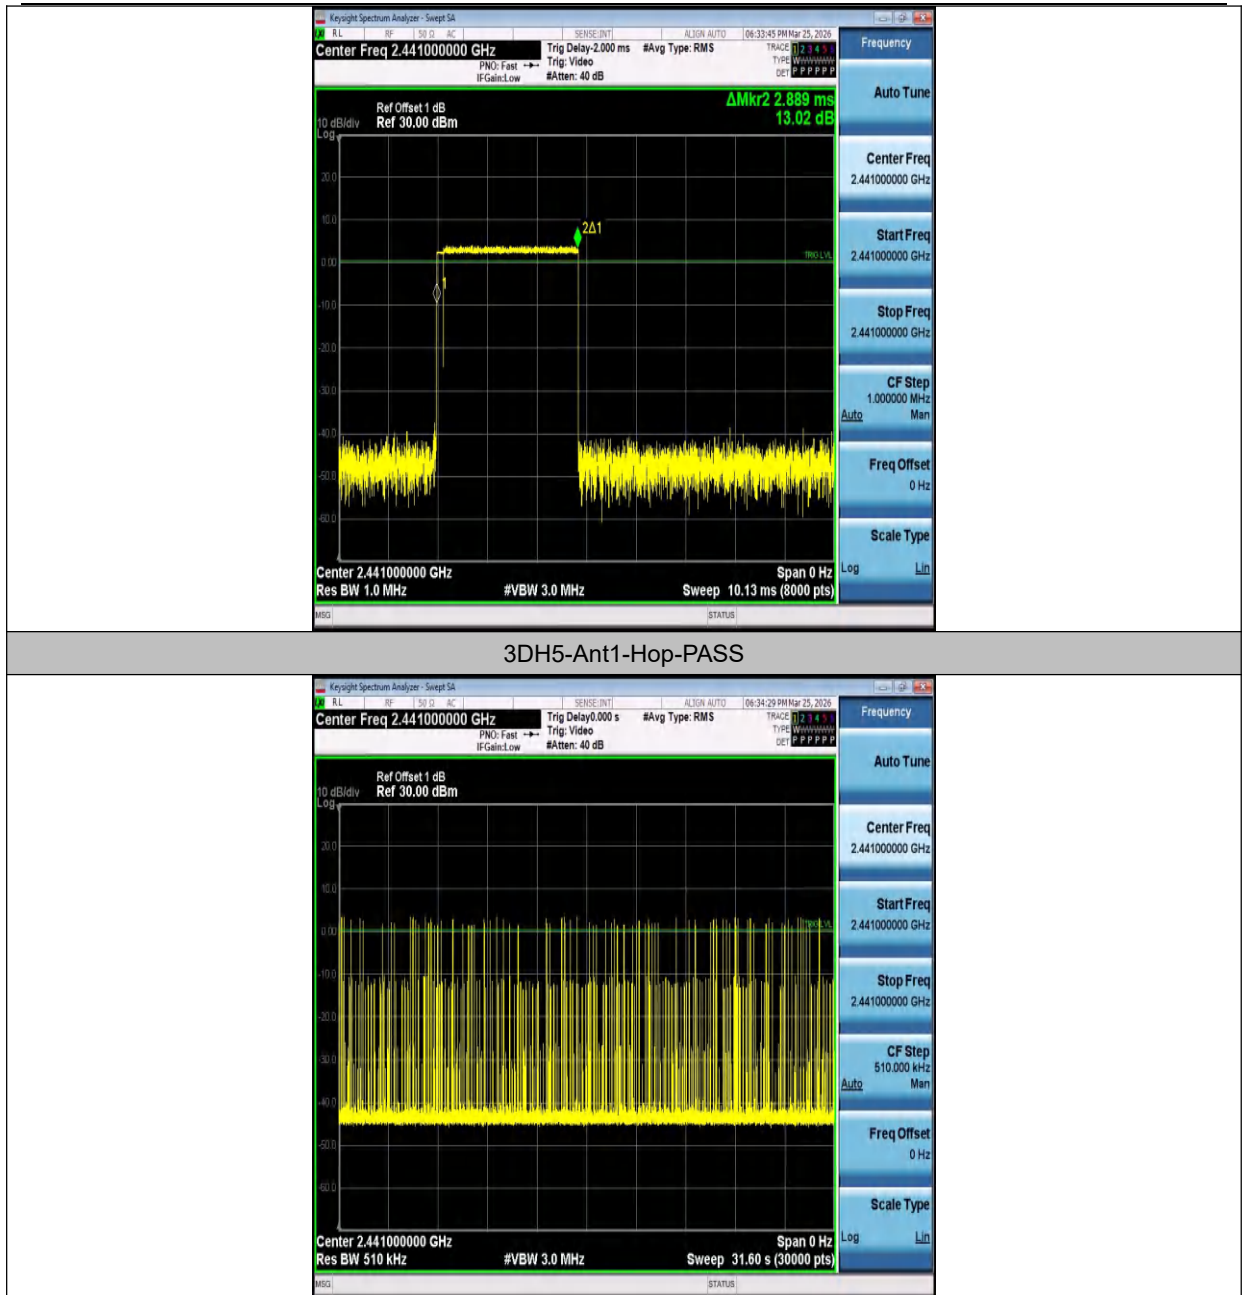

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix F: Number of Hopping Channel

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [Num]	Limit [Num]	Verdict
DH5	Ant1	Hop	79	≥15	PASS
2DH5	Ant1	Hop	79	≥15	PASS
3DH5	Ant1	Hop	79	≥15	PASS


Test Graphs

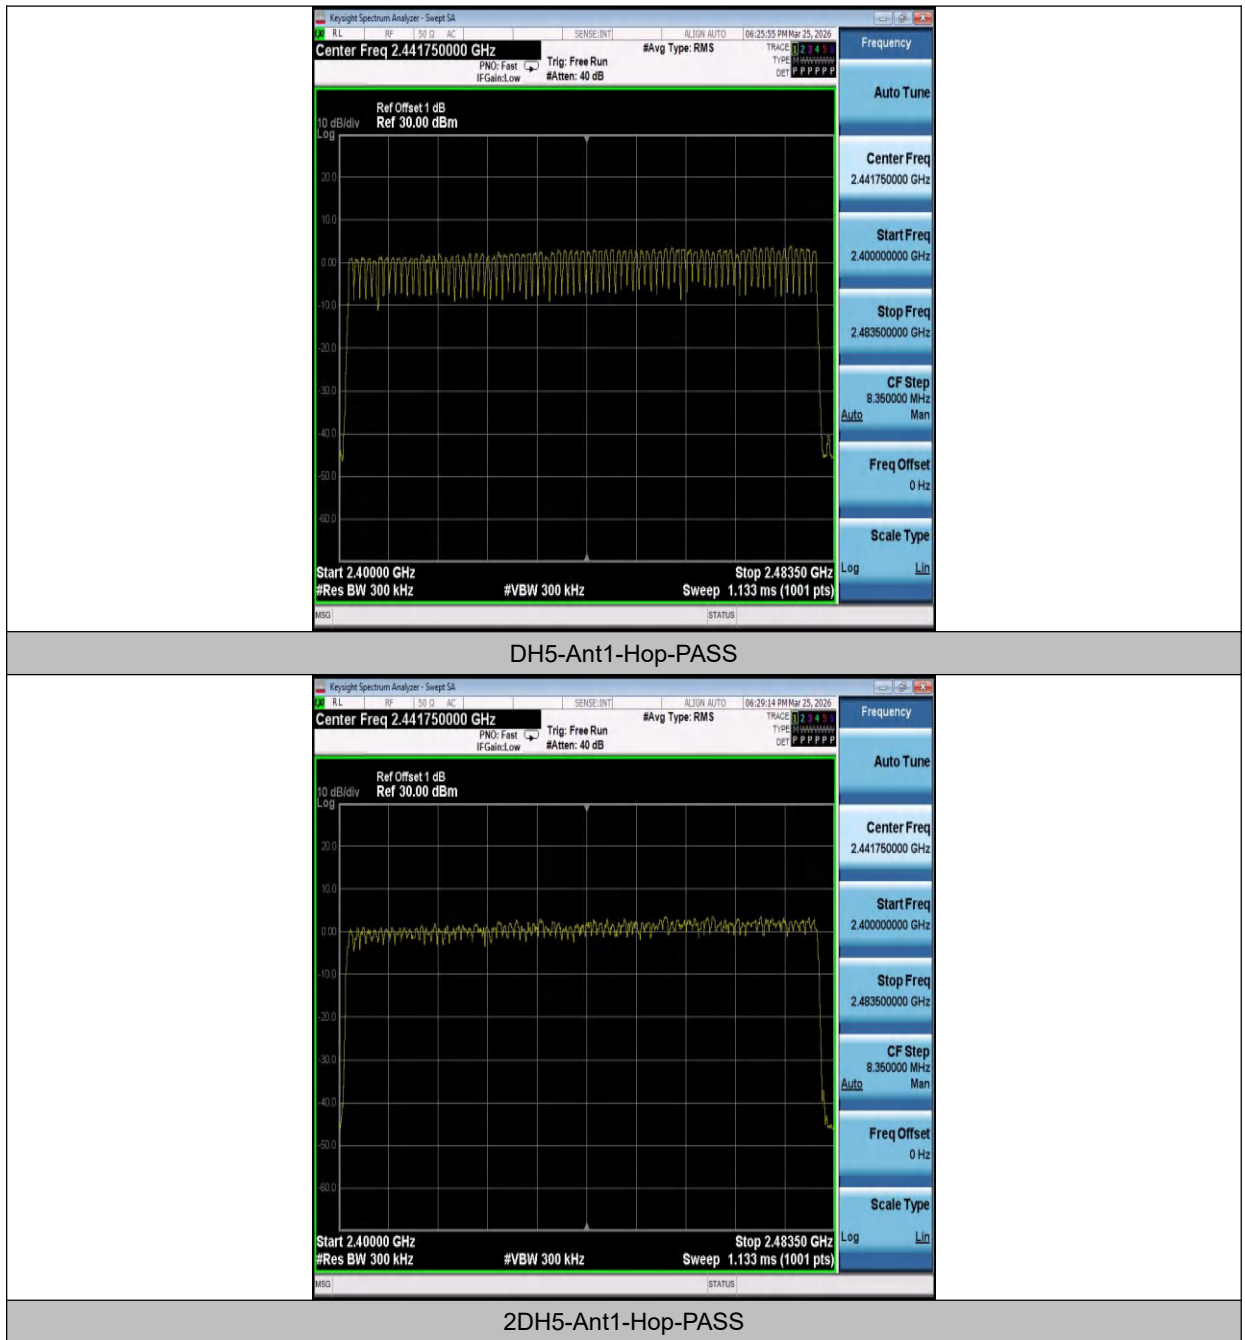

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

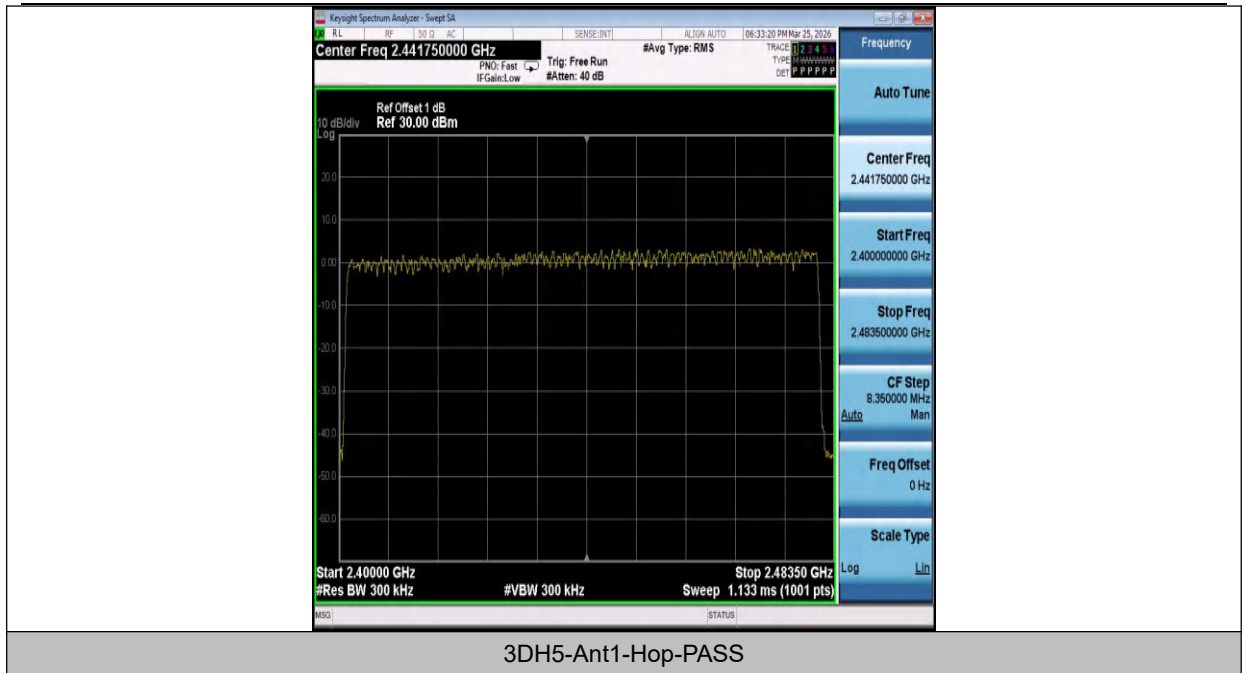

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix G: Conducted Band edge

Test Result

Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	0.73	-52.98	≤-19.27	PASS
DH5	Ant1	High	2480	1.59	-40.88	≤-18.41	PASS
DH5	Ant1	Low	Hop_2402	-0.19	-52.46	≤-20.19	PASS
DH5	Ant1	High	Hop_2480	2.90	-50.91	≤-17.1	PASS
2DH5	Ant1	Low	2402	0.77	-48.65	≤-19.23	PASS
2DH5	Ant1	High	2480	1.65	-41.44	≤-18.35	PASS
2DH5	Ant1	Low	Hop_2402	-1.25	-53.24	≤-21.25	PASS
2DH5	Ant1	High	Hop_2480	1.62	-46.94	≤-18.38	PASS
3DH5	Ant1	Low	2402	1.25	-42.7	≤-18.76	PASS
3DH5	Ant1	High	2480	1.59	-42.23	≤-18.41	PASS
3DH5	Ant1	Low	Hop_2402	-0.44	-52.46	≤-20.44	PASS
3DH5	Ant1	High	Hop_2480	0.68	-50.57	≤-19.32	PASS


Test Graphs

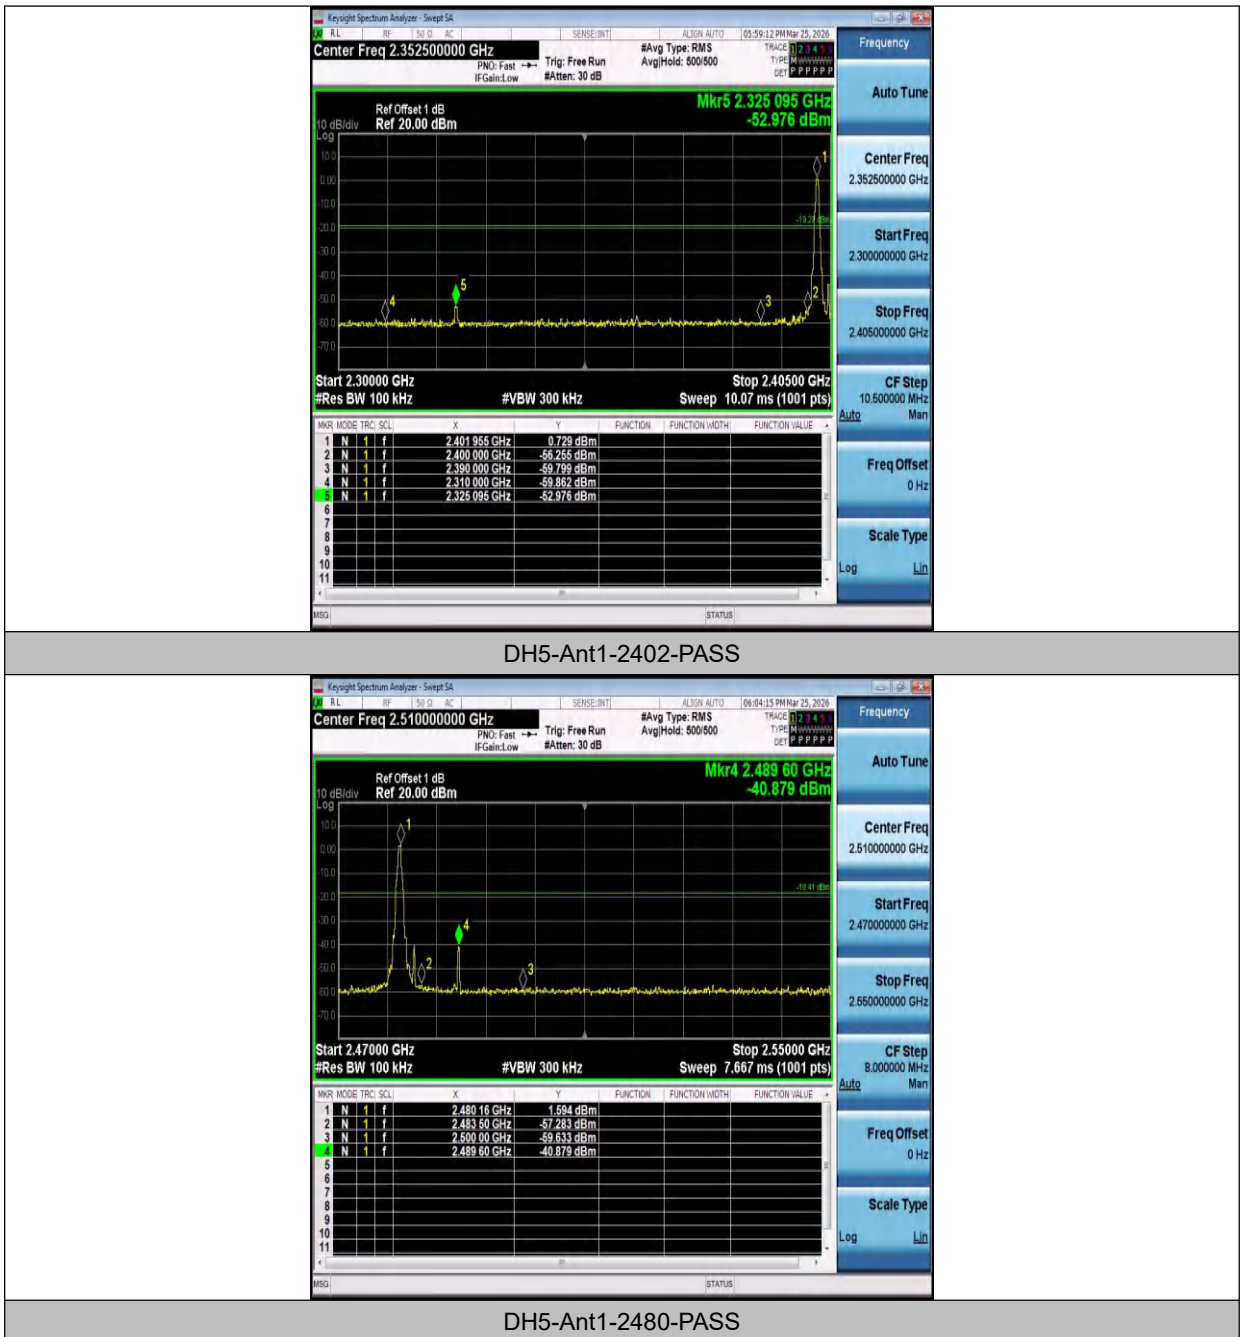



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

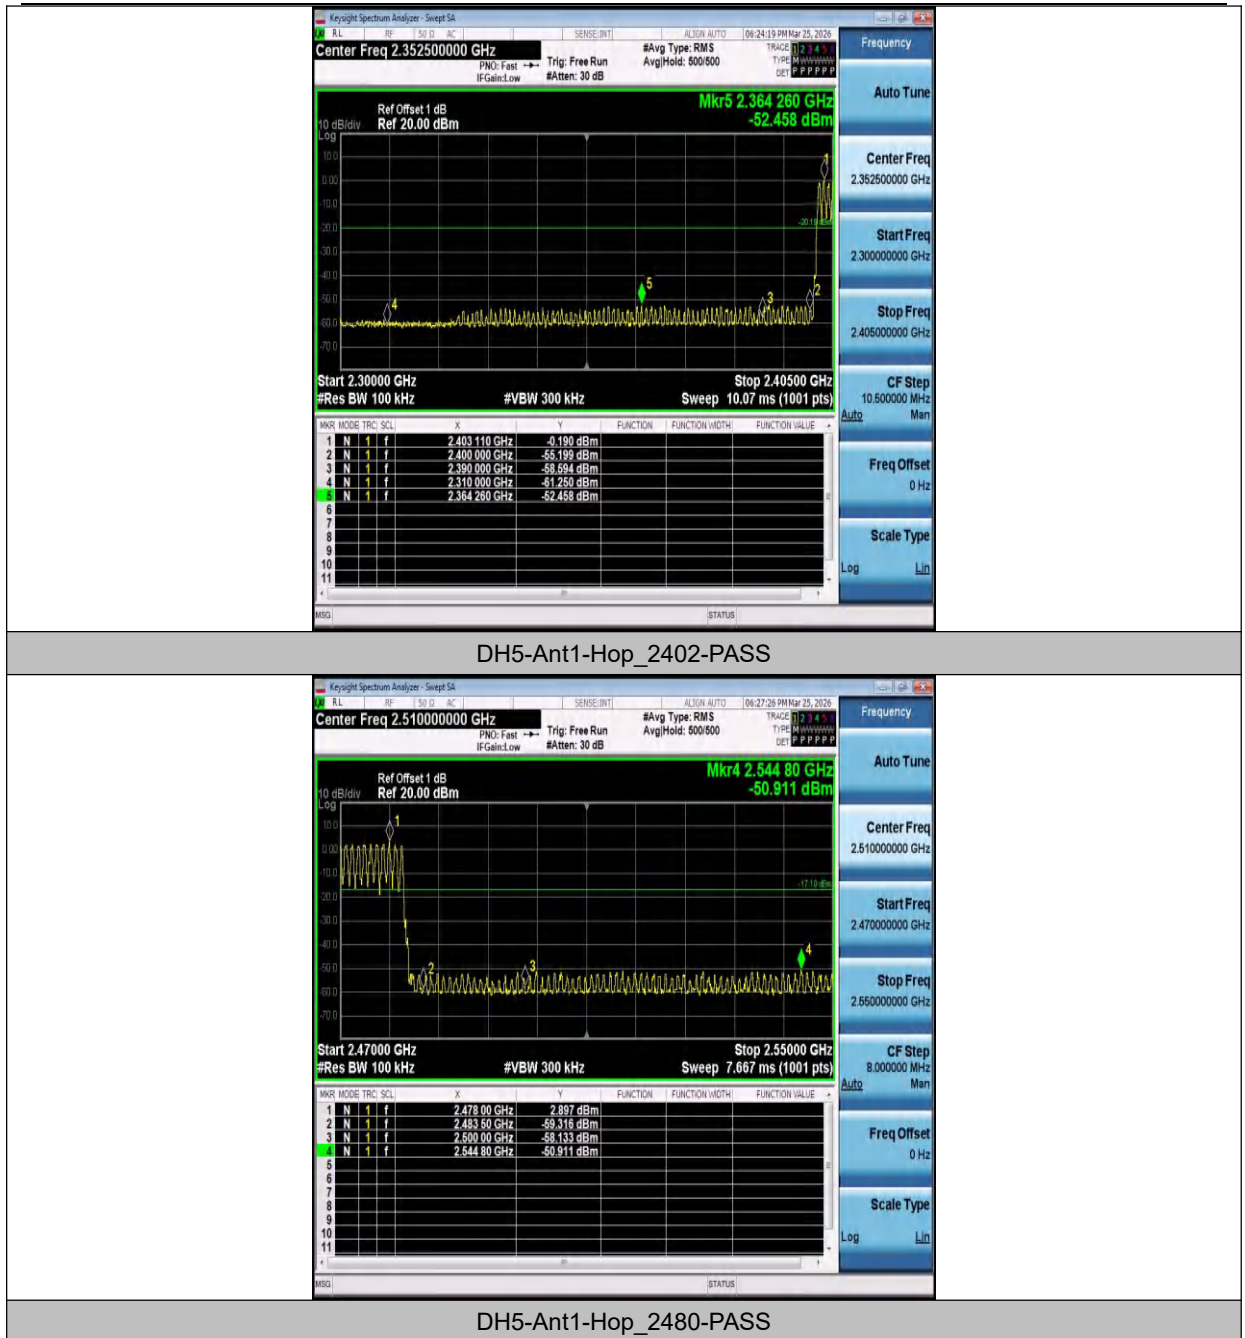

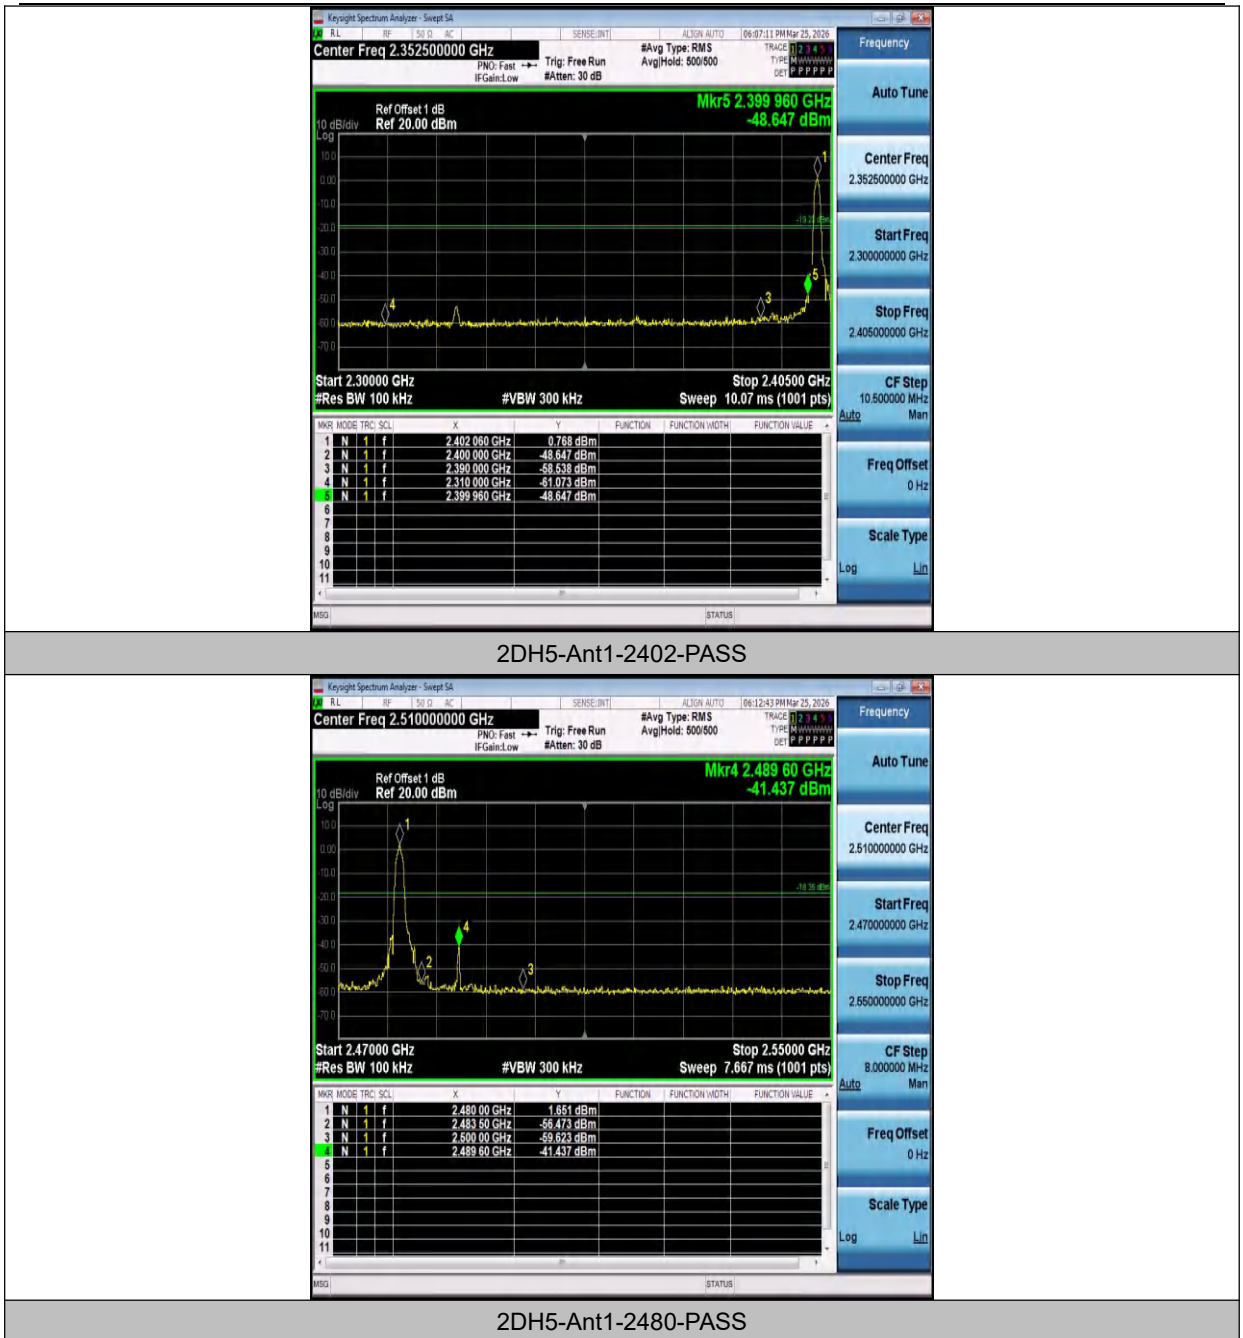

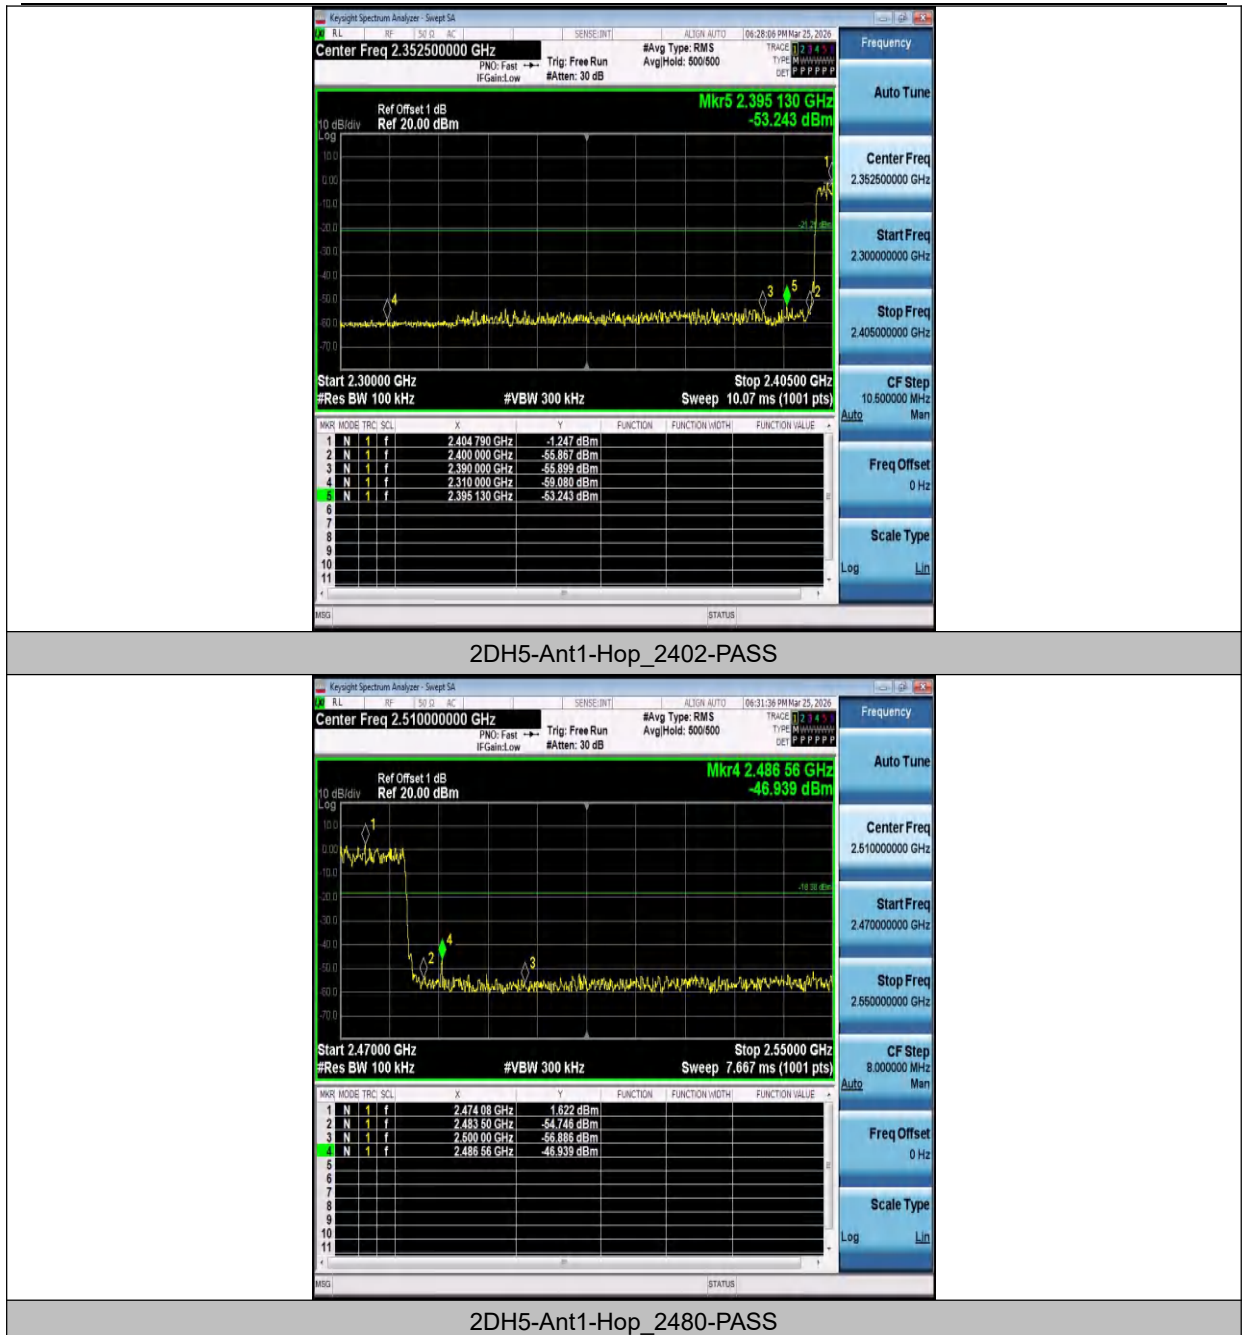

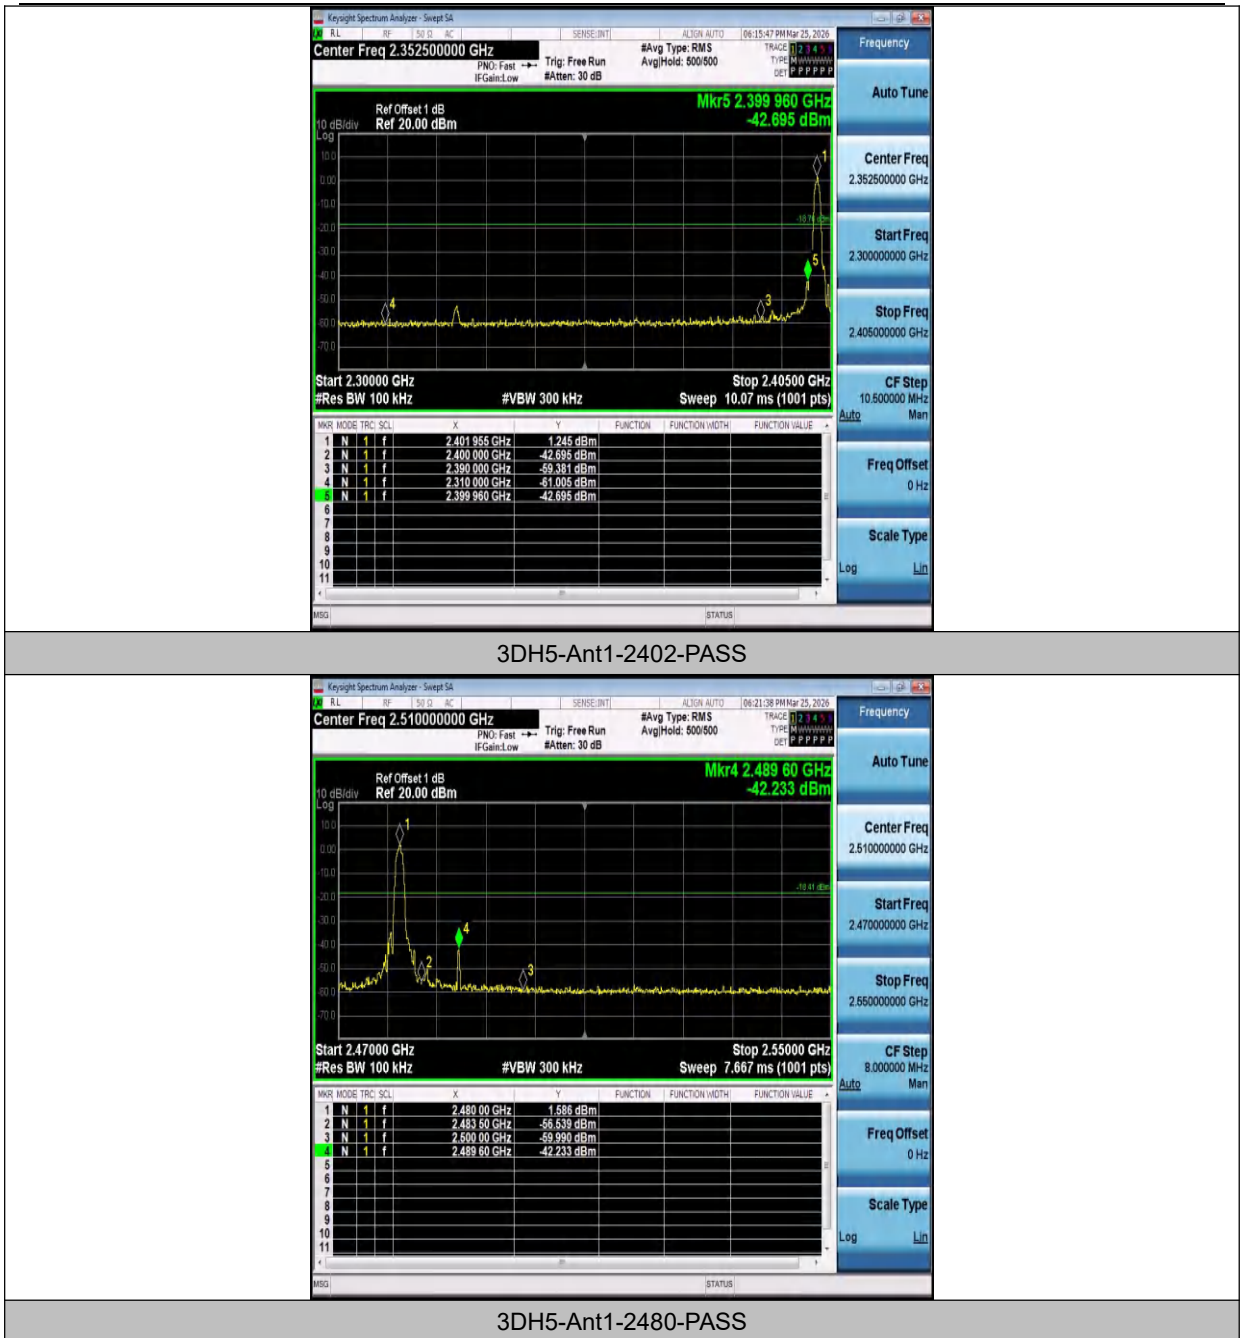

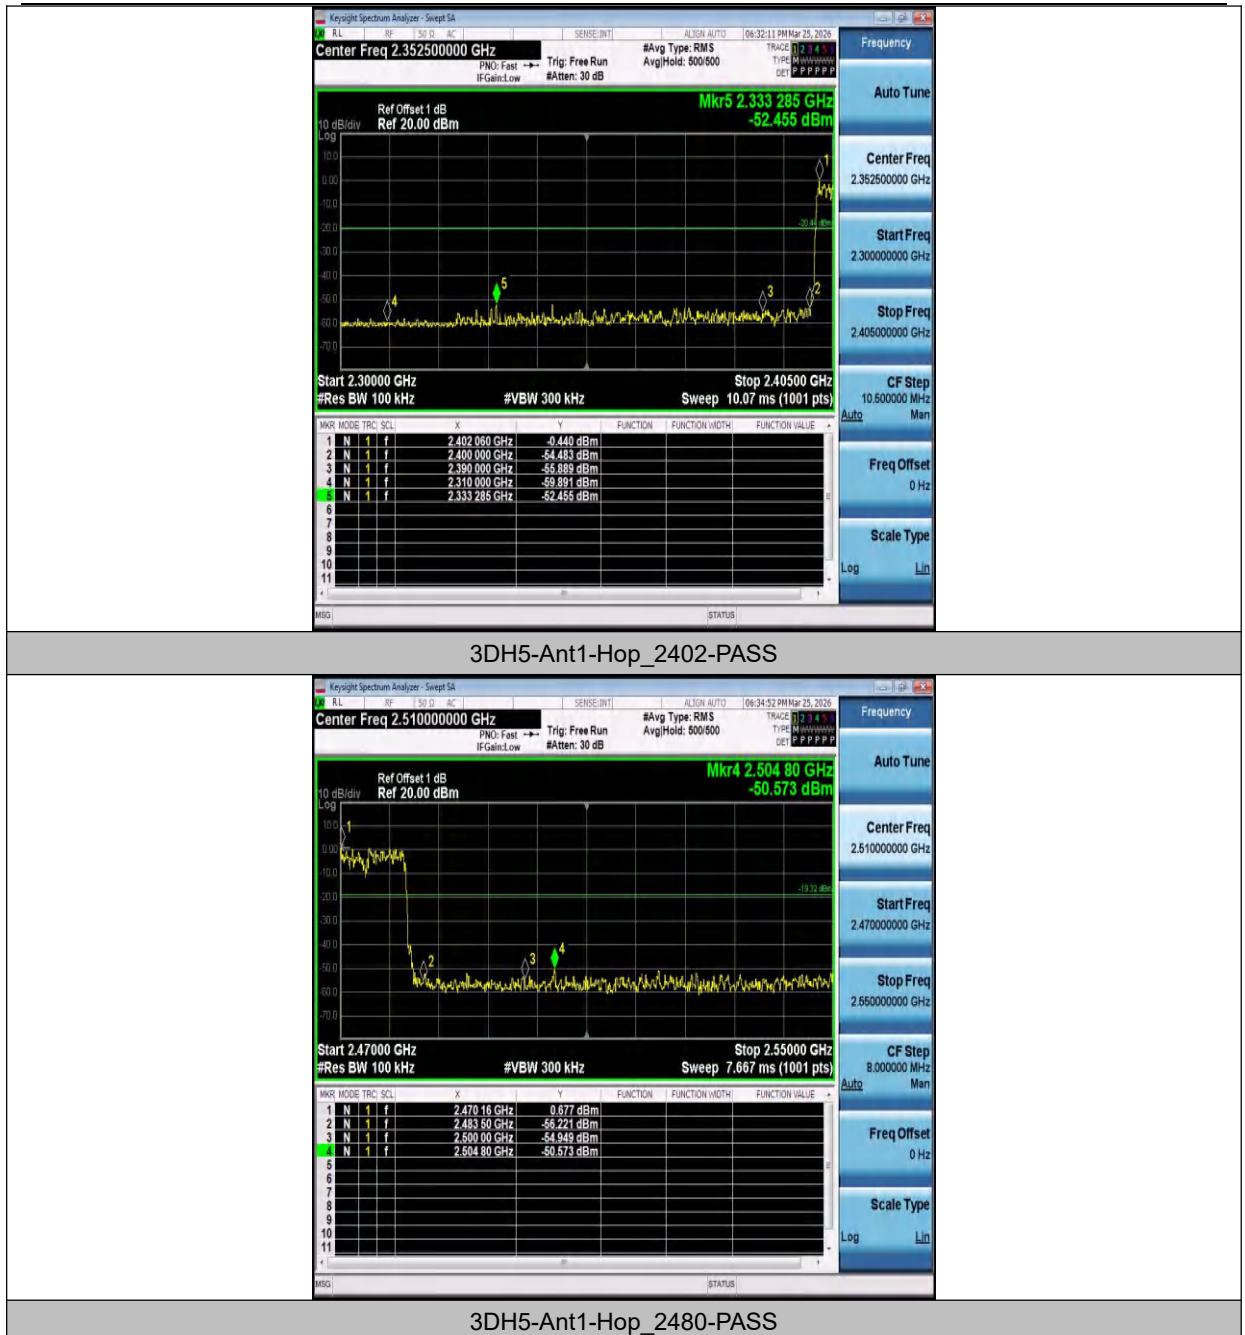


Appendix H: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	0.92	0.92	---	PASS
DH5	Ant1	2402	30~1000	0.92	-59.19	≤-19.08	PASS
DH5	Ant1	2402	1000~26500	0.92	-49.02	≤-19.08	PASS
DH5	Ant1	2441	0~Reference	0.96	0.96	---	PASS
DH5	Ant1	2441	30~1000	0.96	-58.95	≤-19.04	PASS
DH5	Ant1	2441	1000~26500	0.96	-47.98	≤-19.04	PASS
DH5	Ant1	2480	0~Reference	0.92	0.92	---	PASS
DH5	Ant1	2480	30~1000	0.92	-59.05	≤-19.08	PASS
DH5	Ant1	2480	1000~26500	0.92	-48.72	≤-19.08	PASS
2DH5	Ant1	2402	0~Reference	0.90	0.90	---	PASS
2DH5	Ant1	2402	30~1000	0.90	-58.35	≤-19.1	PASS
2DH5	Ant1	2402	1000~26500	0.90	-48.55	≤-19.1	PASS
2DH5	Ant1	2441	0~Reference	1.52	1.52	---	PASS
2DH5	Ant1	2441	30~1000	1.52	-59.36	≤-18.48	PASS
2DH5	Ant1	2441	1000~26500	1.52	-48.63	≤-18.48	PASS
2DH5	Ant1	2480	0~Reference	1.43	1.43	---	PASS
2DH5	Ant1	2480	30~1000	1.43	-58.93	≤-18.57	PASS
2DH5	Ant1	2480	1000~26500	1.43	-48.29	≤-18.57	PASS
3DH5	Ant1	2402	0~Reference	1.04	1.04	---	PASS
3DH5	Ant1	2402	30~1000	1.04	-59.72	≤-18.96	PASS
3DH5	Ant1	2402	1000~26500	1.04	-48.36	≤-18.96	PASS
3DH5	Ant1	2441	0~Reference	0.97	0.97	---	PASS
3DH5	Ant1	2441	30~1000	0.97	-59.39	≤-19.03	PASS
3DH5	Ant1	2441	1000~26500	0.97	-48.06	≤-19.03	PASS
3DH5	Ant1	2480	0~Reference	1.44	1.44	---	PASS
3DH5	Ant1	2480	30~1000	1.44	-59.47	≤-18.56	PASS
3DH5	Ant1	2480	1000~26500	1.44	-48.3	≤-18.56	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'Input Correction' of the Spectrum Analyzer during the test.


Test Graphs

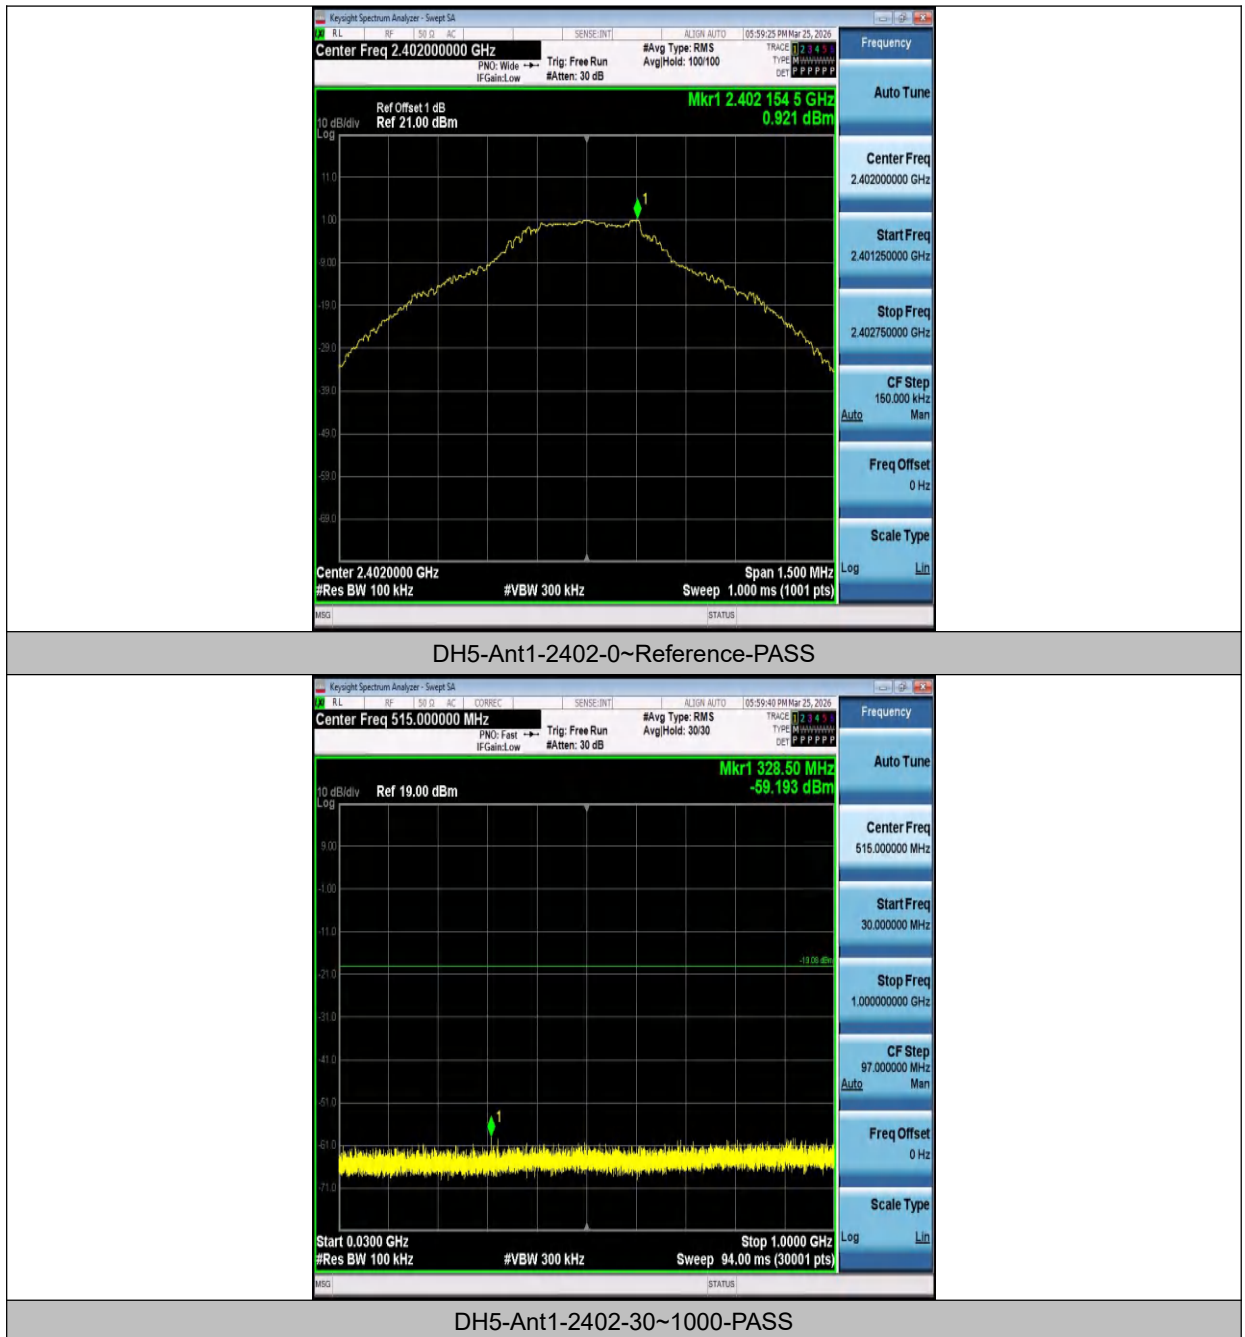

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

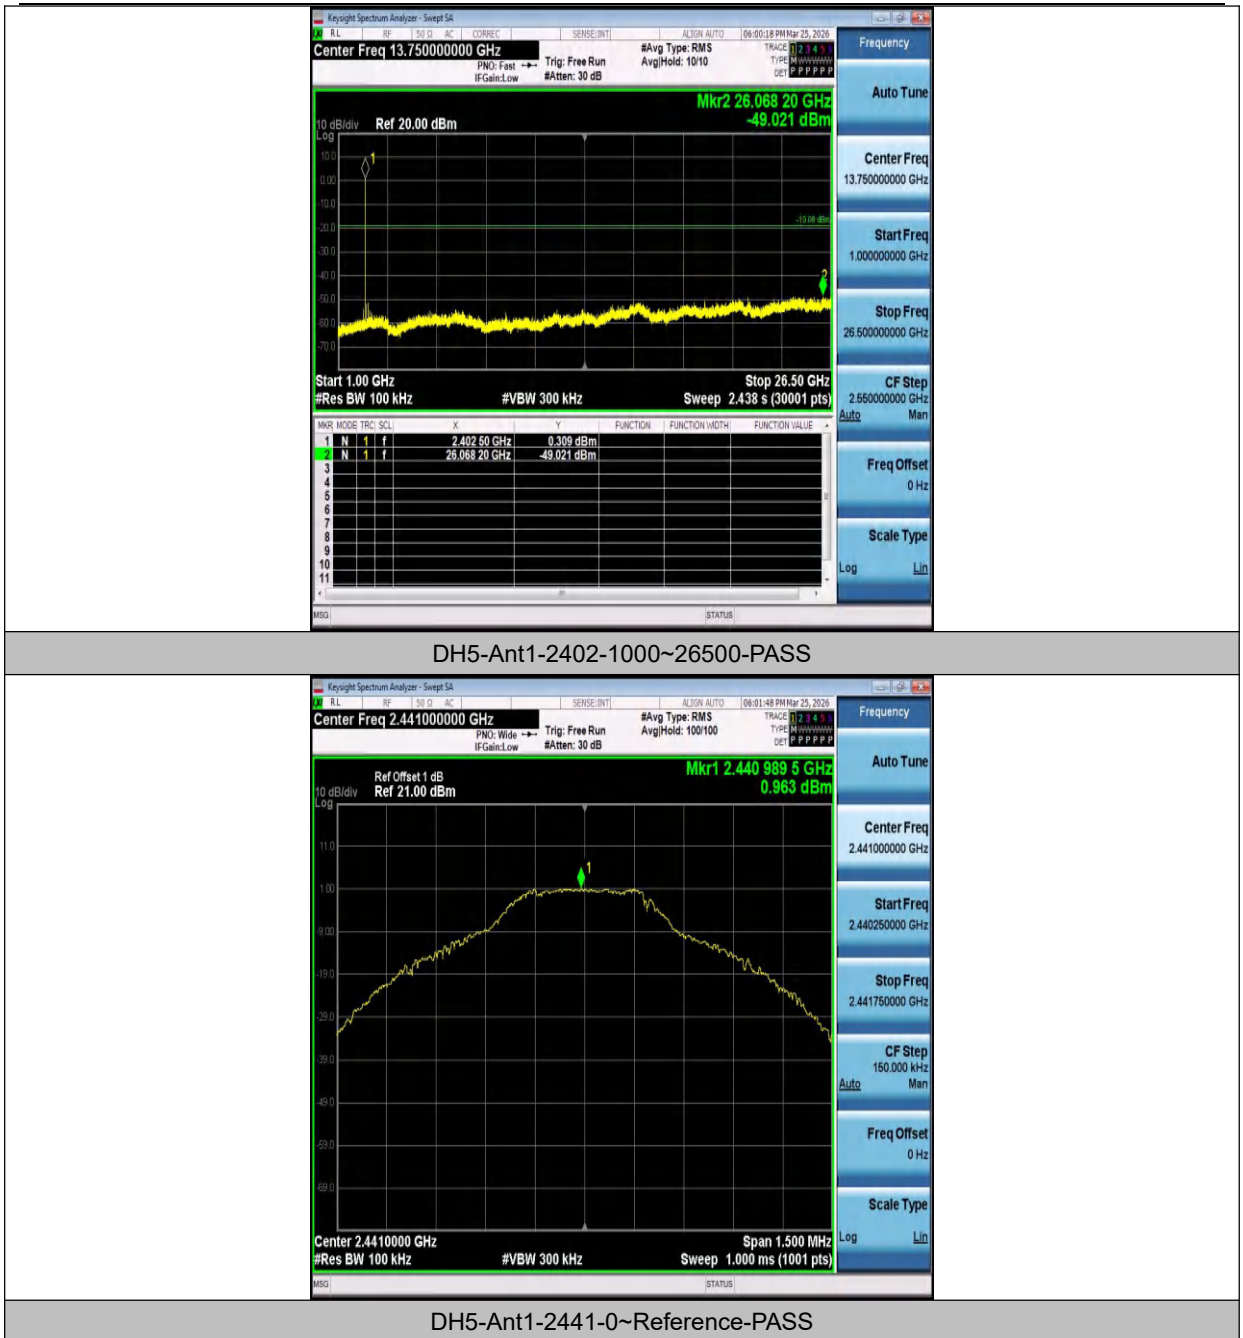

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

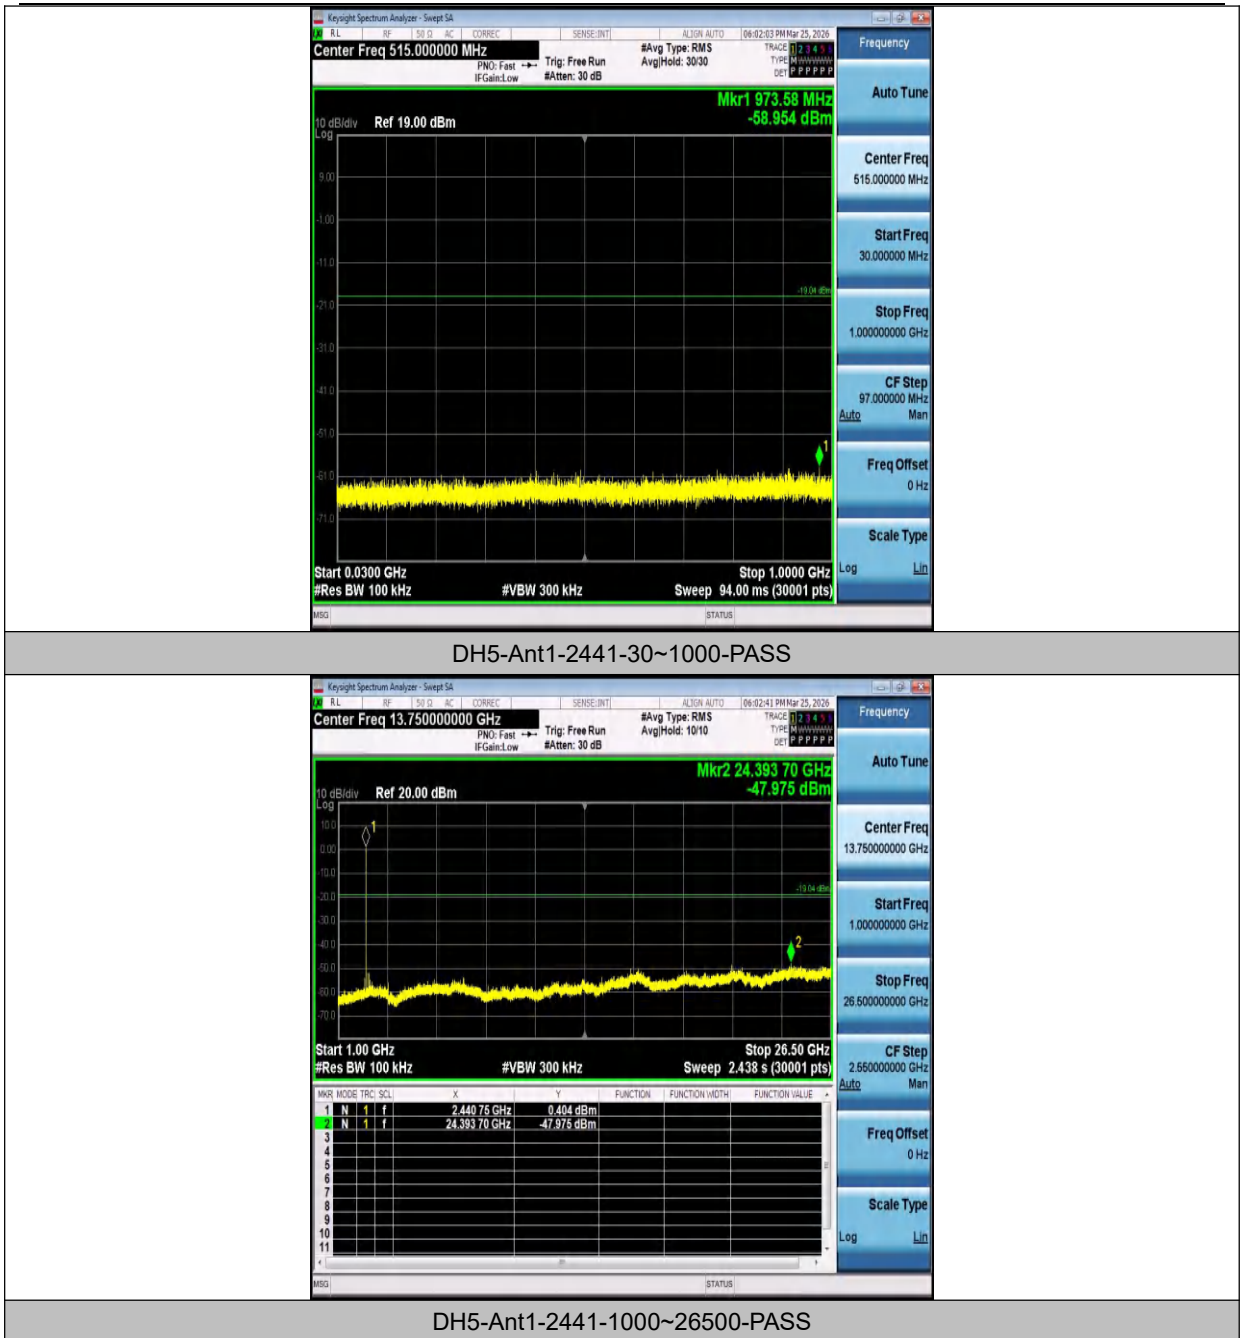

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

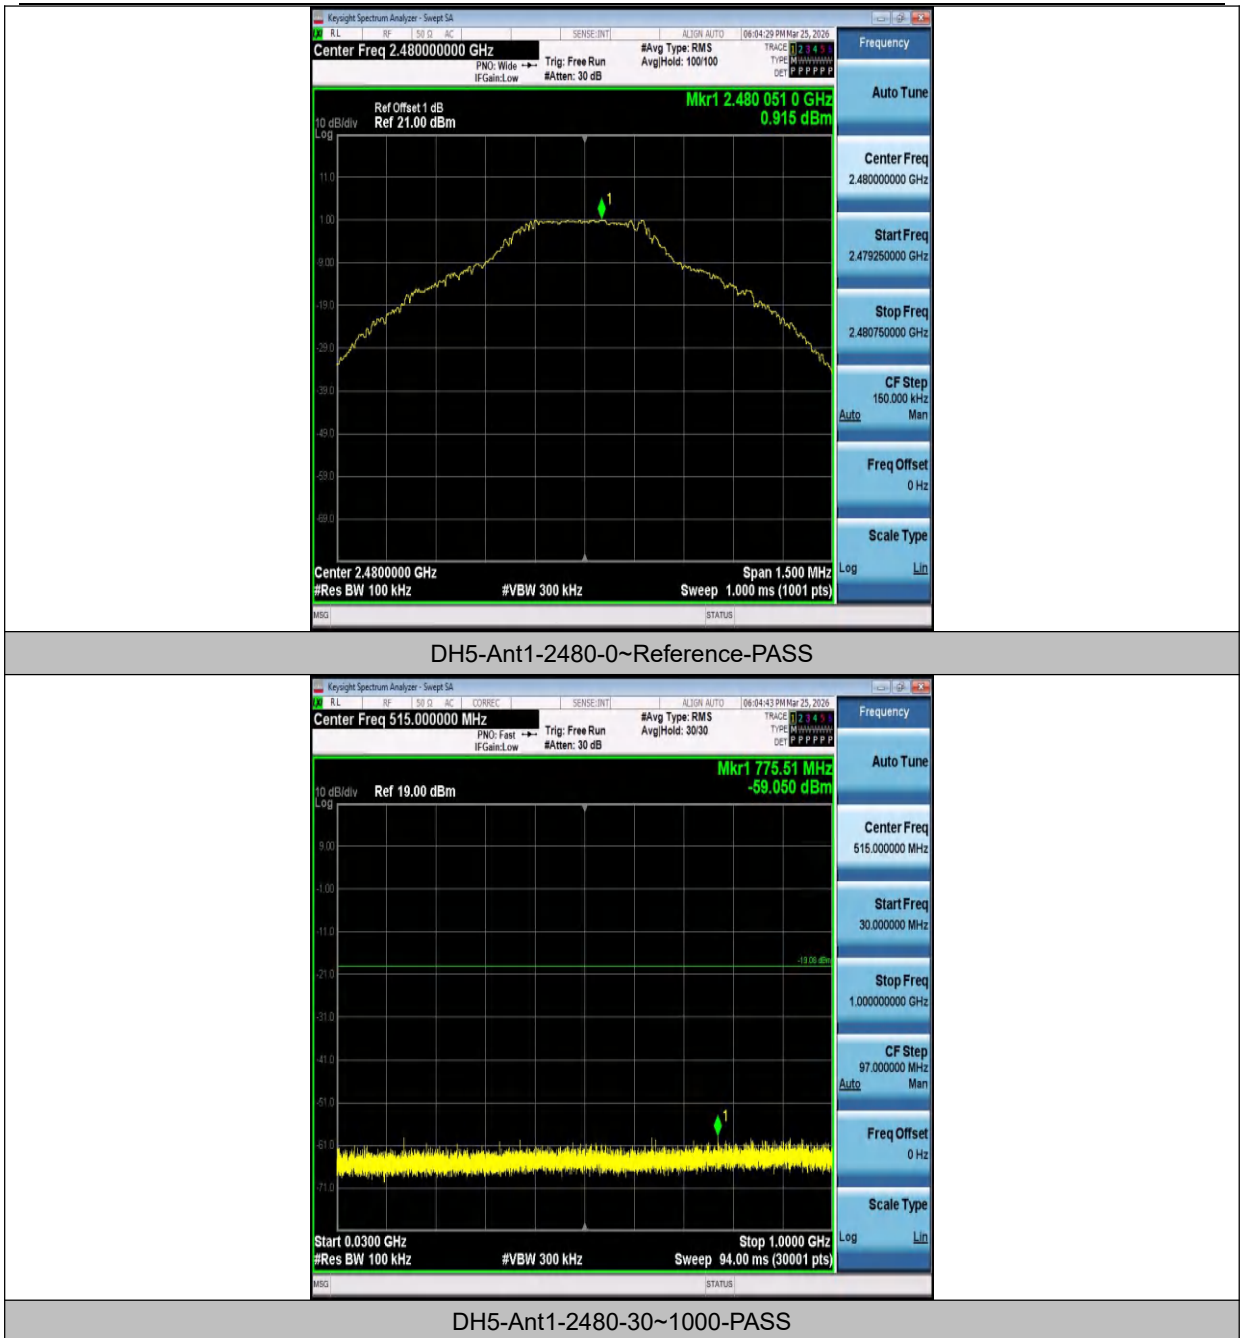

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

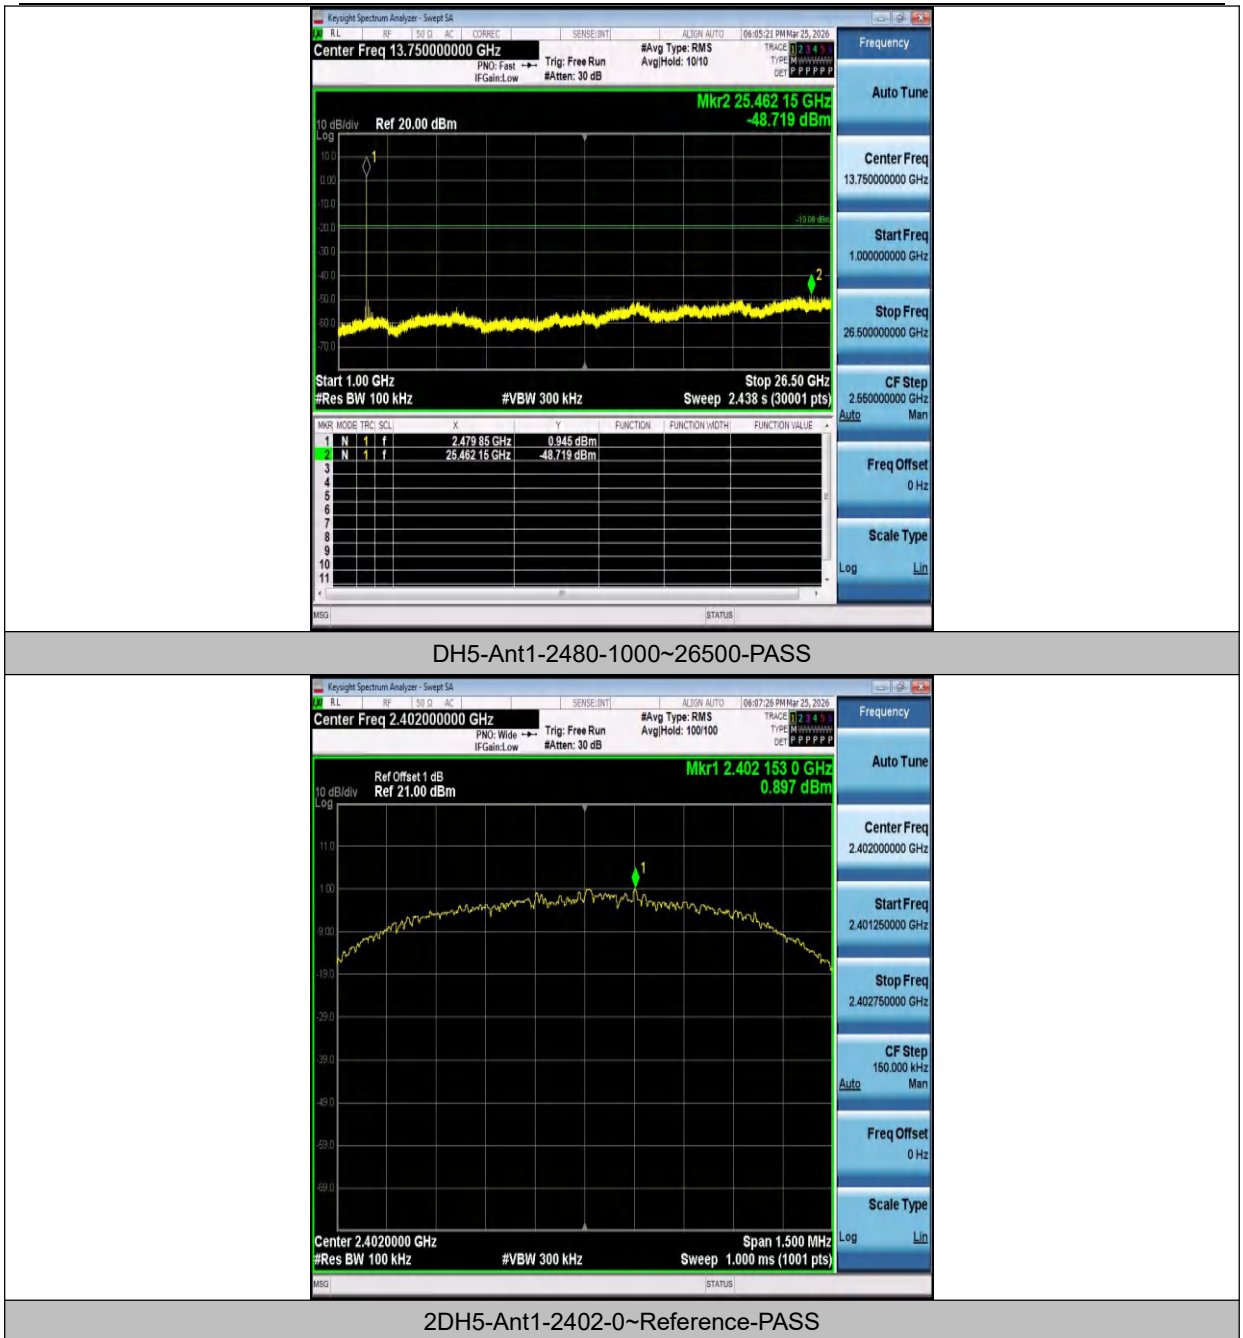

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

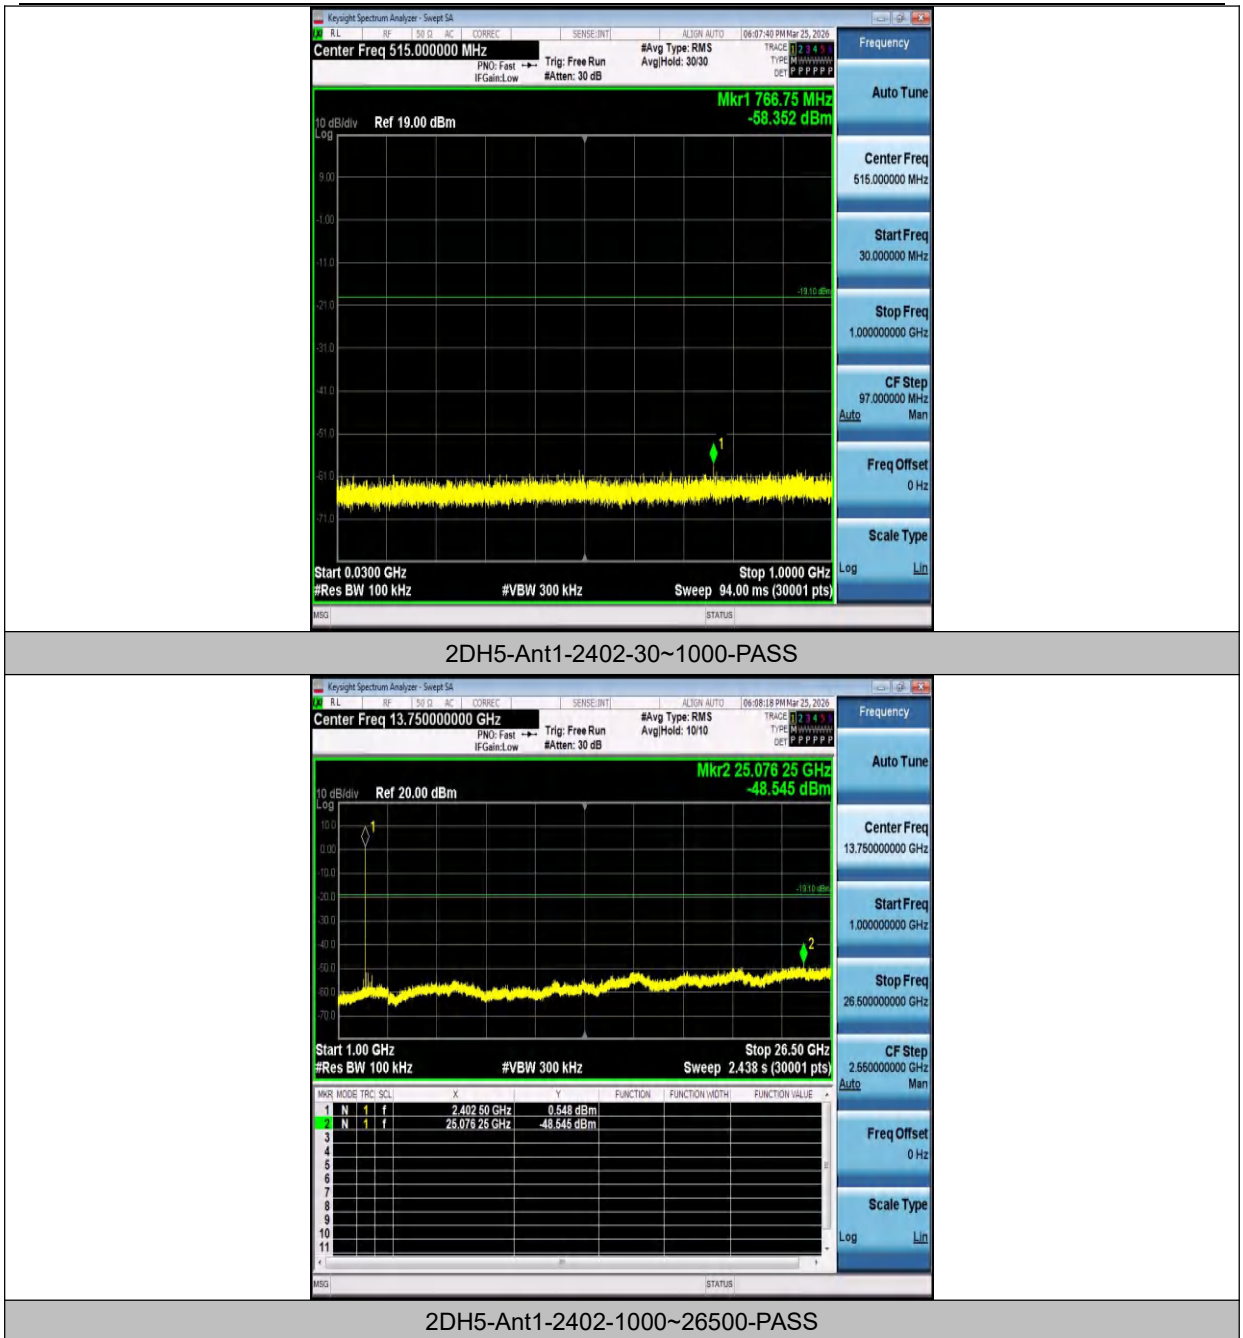

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

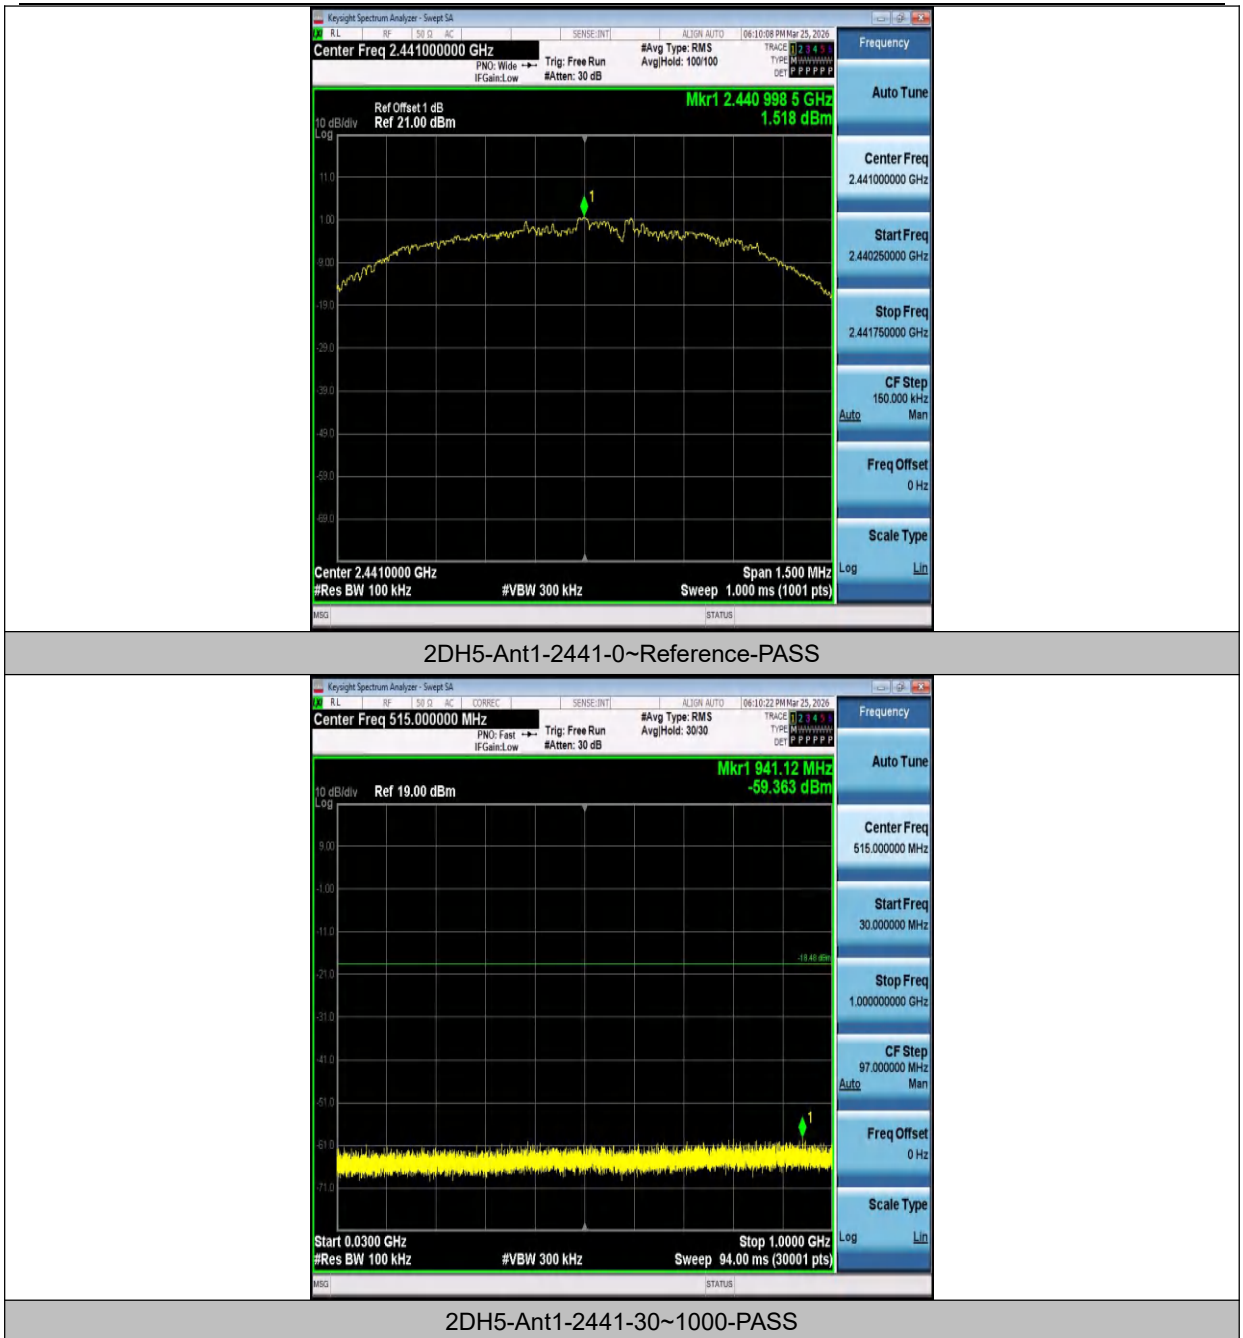

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

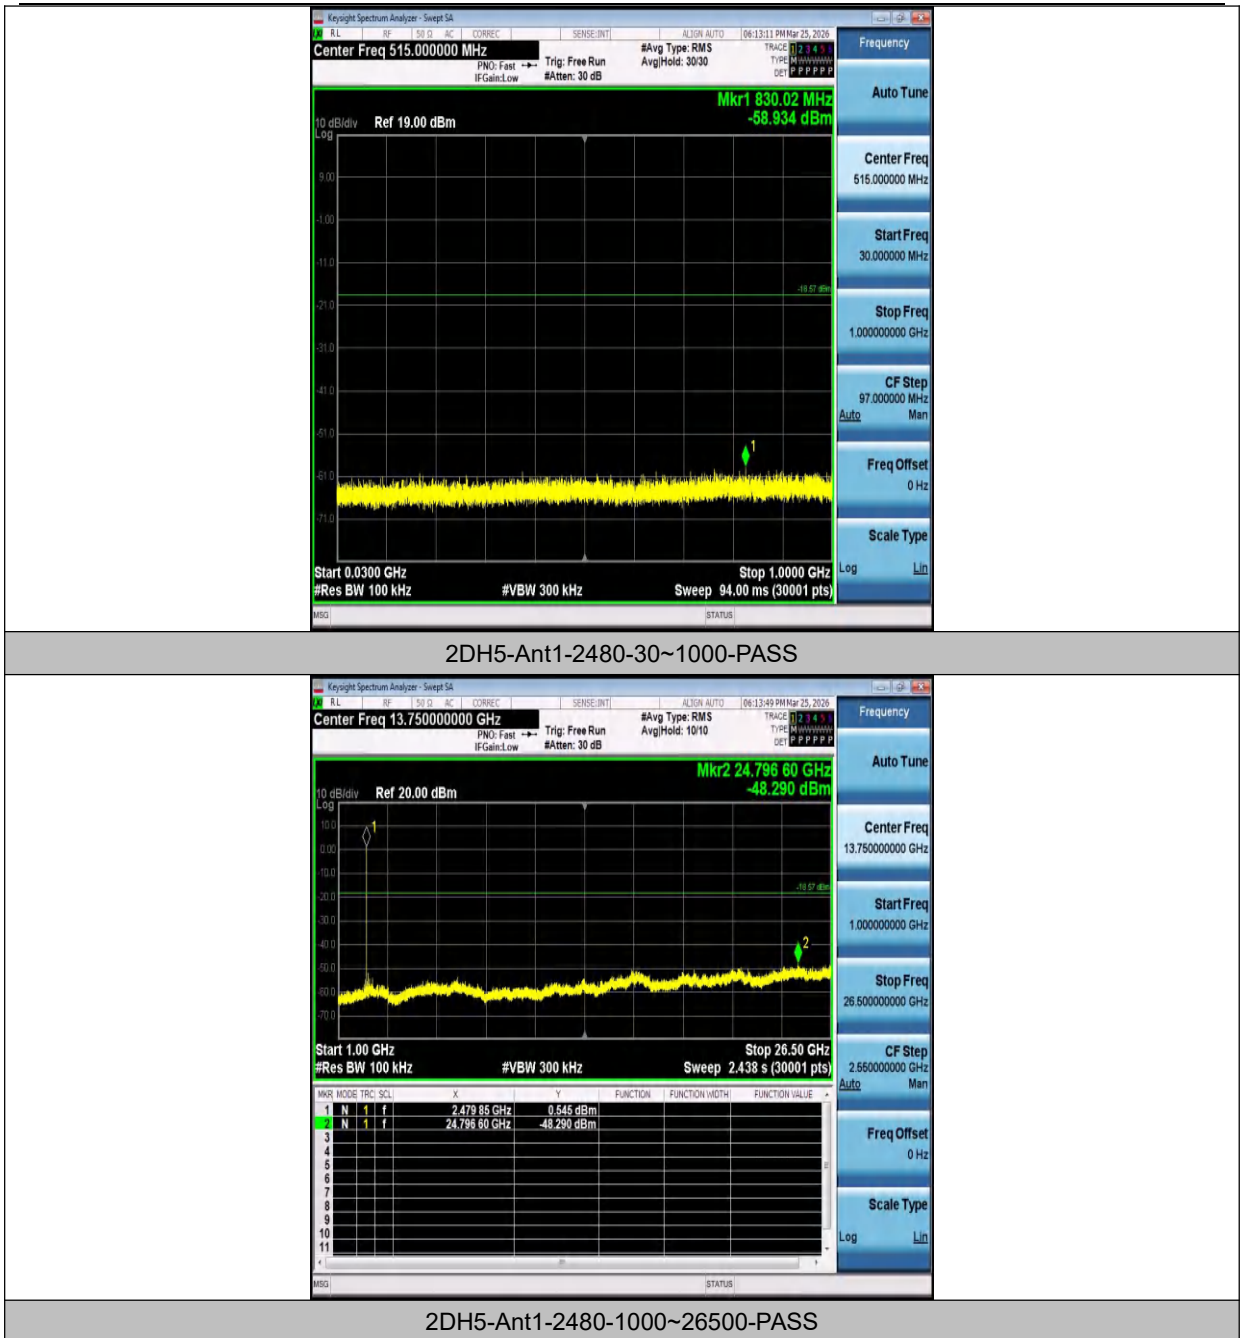

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

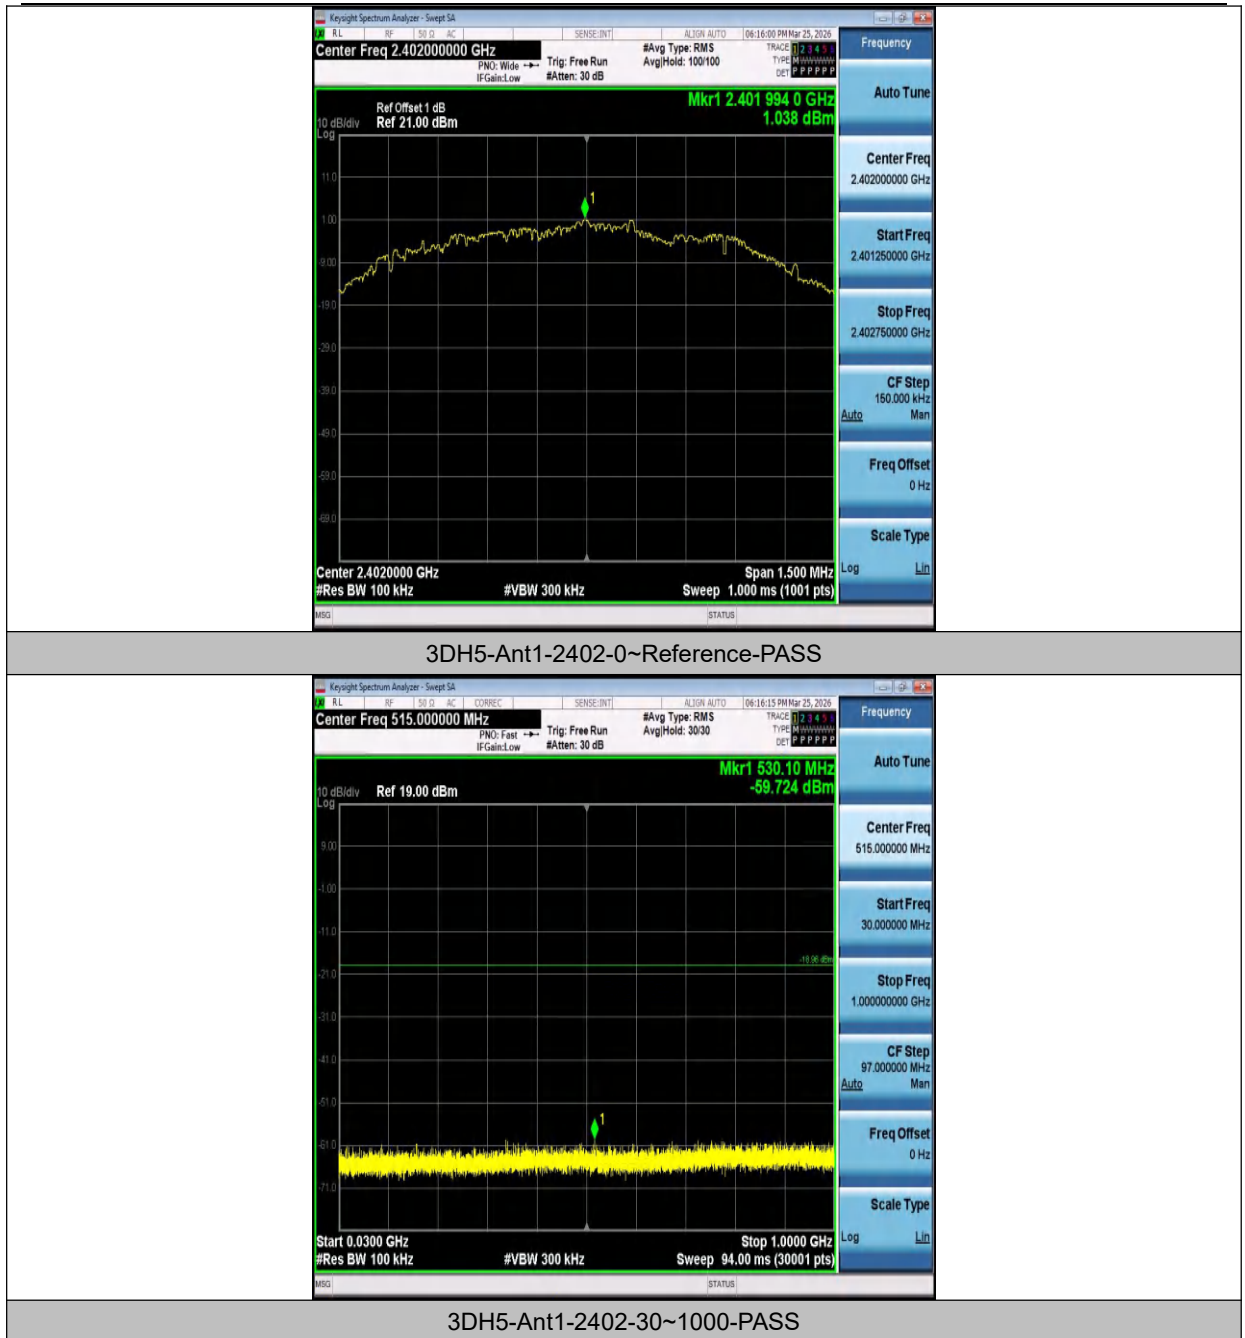

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

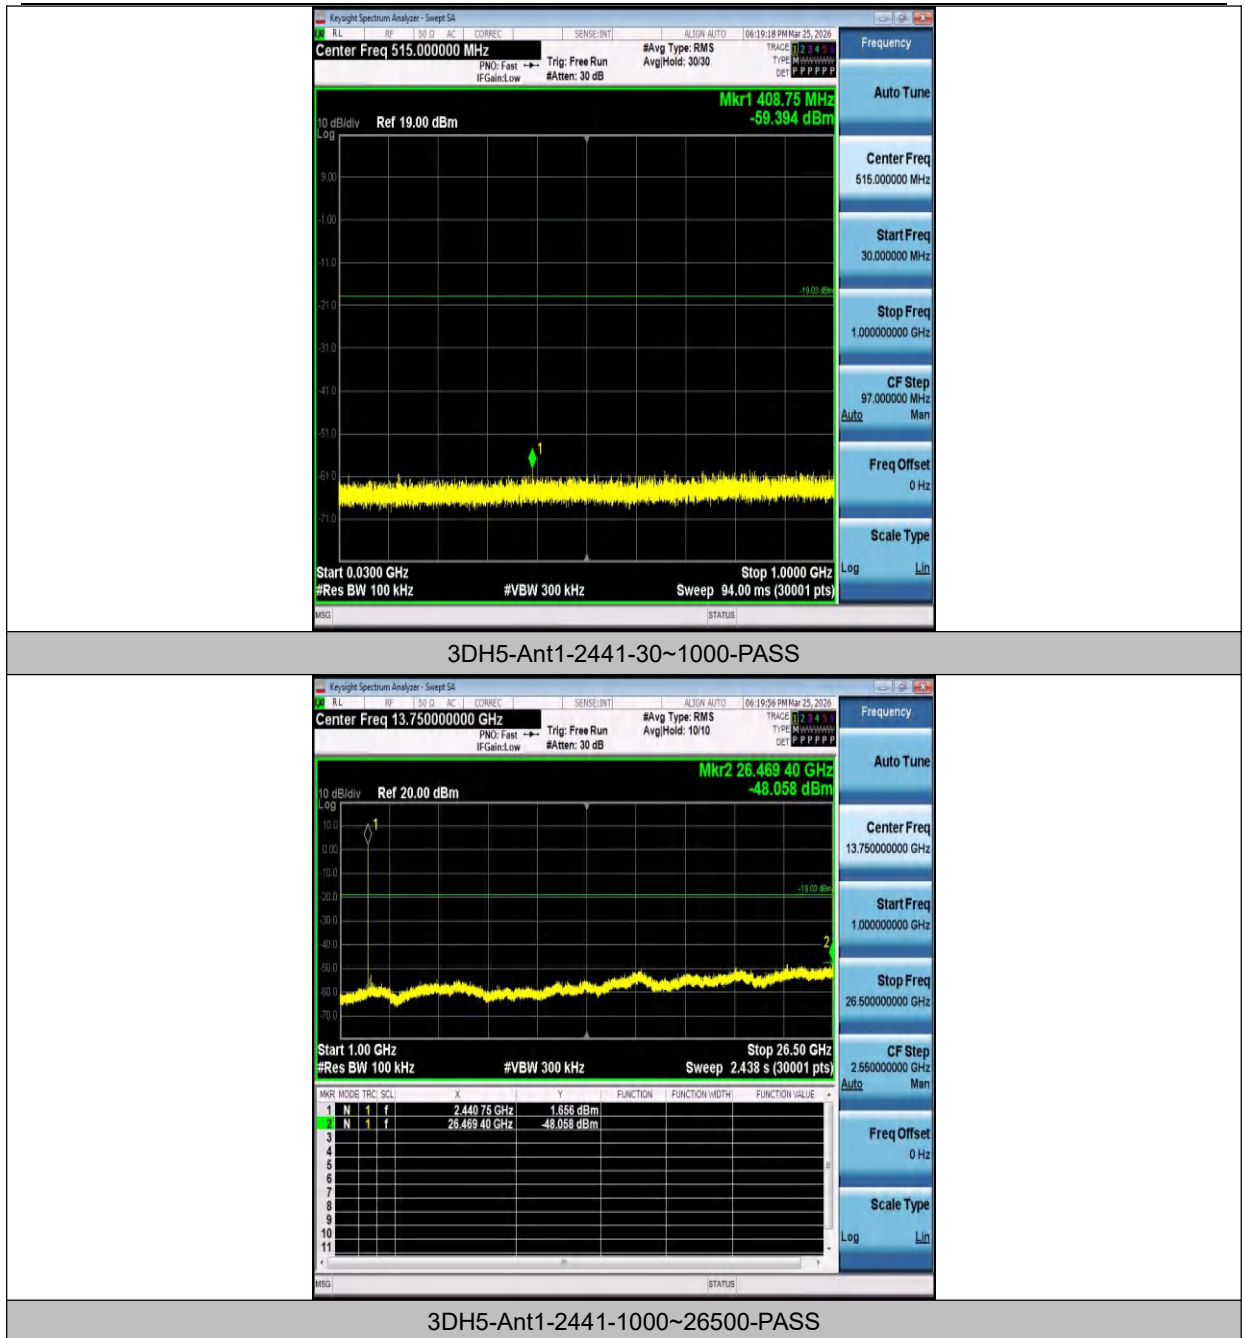

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

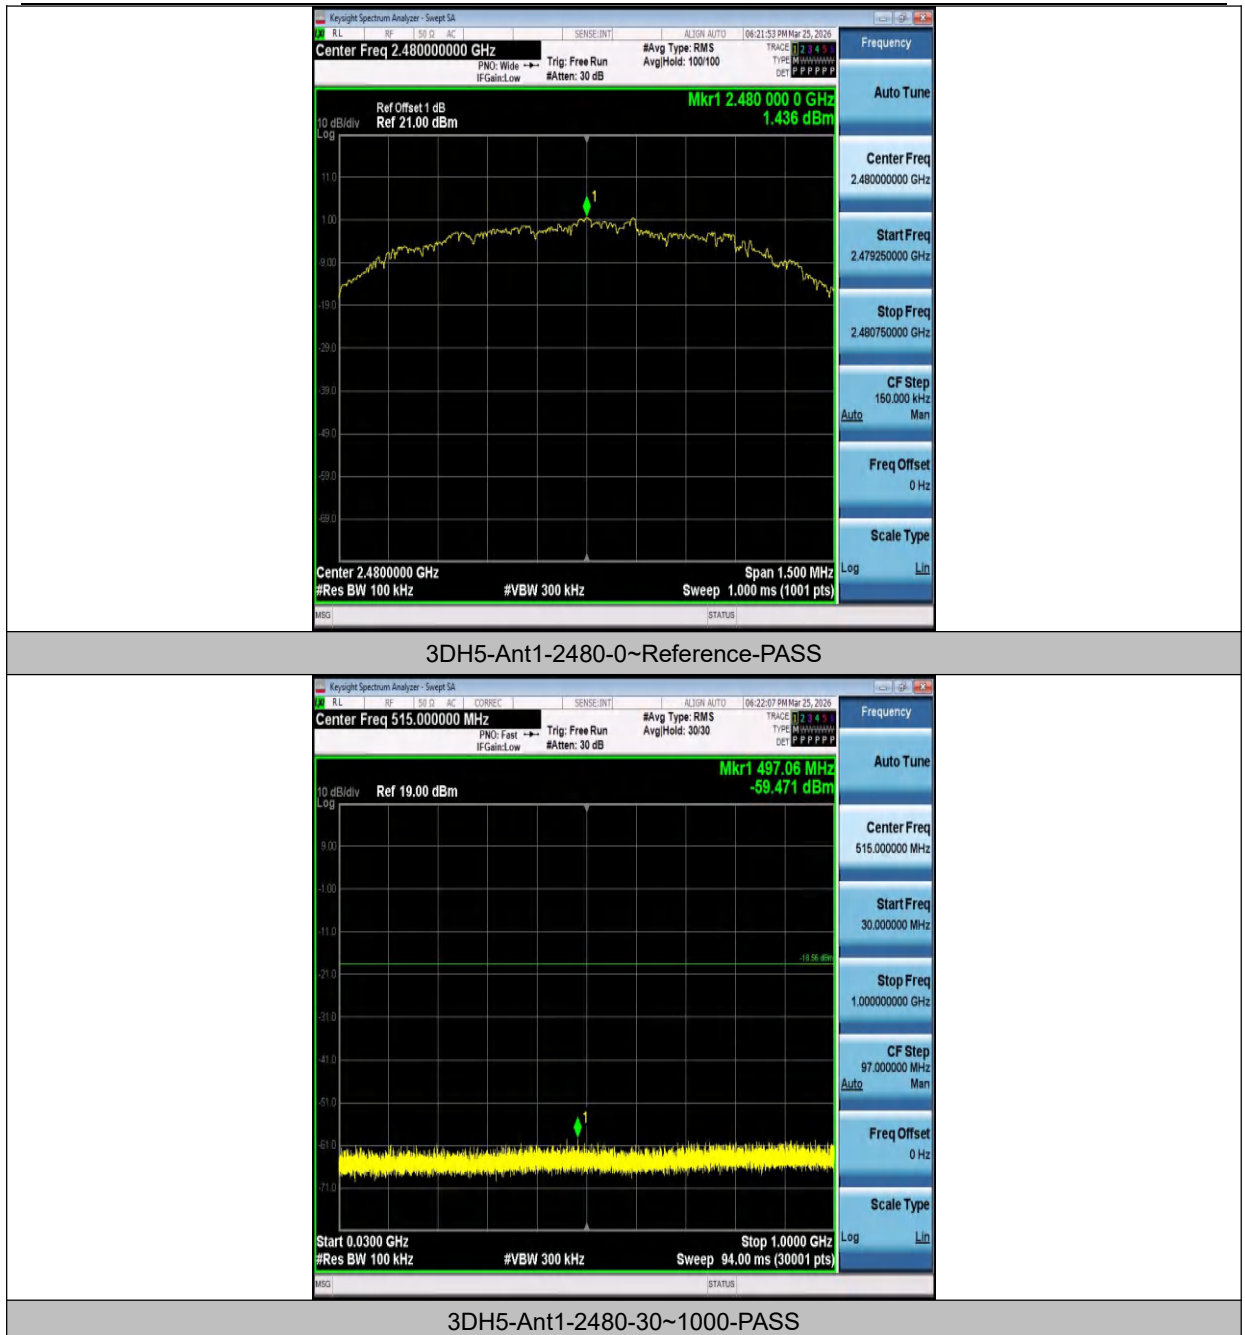

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

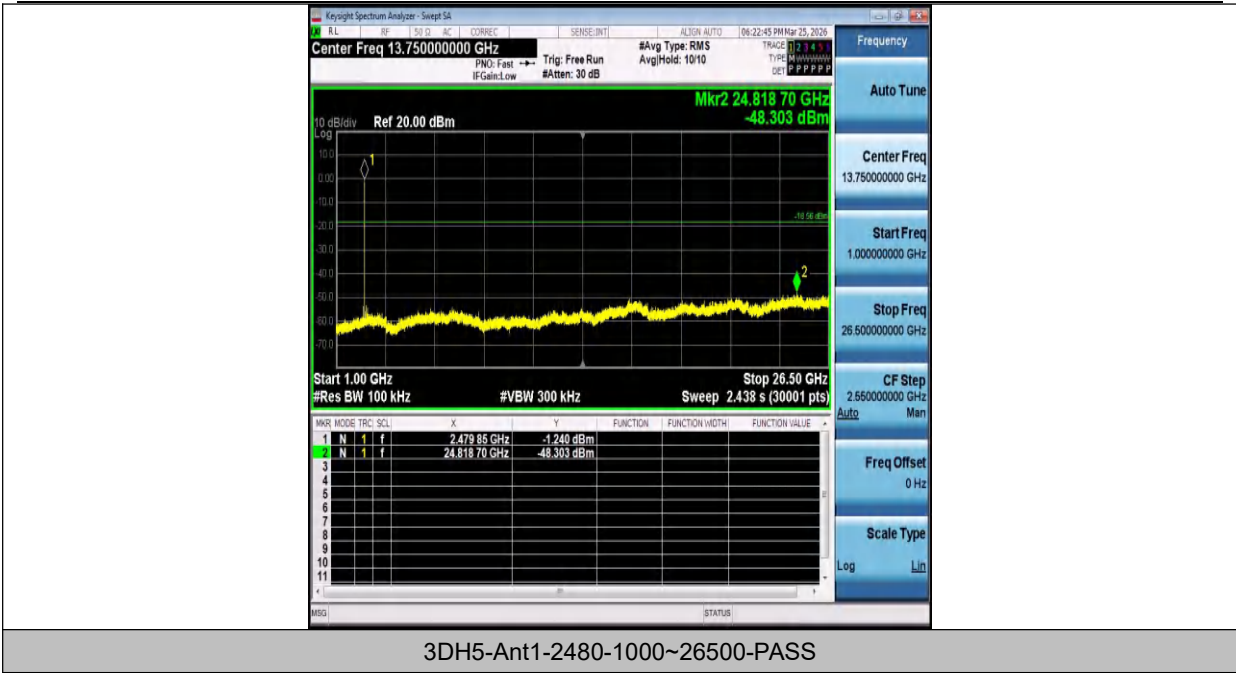

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix I: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	2.89	3.75	77.07	1.13
DH5	Ant1	2441	2.88	3.75	76.80	1.15
DH5	Ant1	2480	2.88	3.75	76.80	1.15
2DH5	Ant1	2402	2.90	3.75	77.33	1.12
2DH5	Ant1	2441	2.90	3.75	77.33	1.12
2DH5	Ant1	2480	2.88	3.75	76.80	1.15
3DH5	Ant1	2402	2.89	3.75	77.07	1.13
3DH5	Ant1	2441	2.88	3.75	76.80	1.15
3DH5	Ant1	2480	2.88	3.75	76.80	1.15

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com






Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



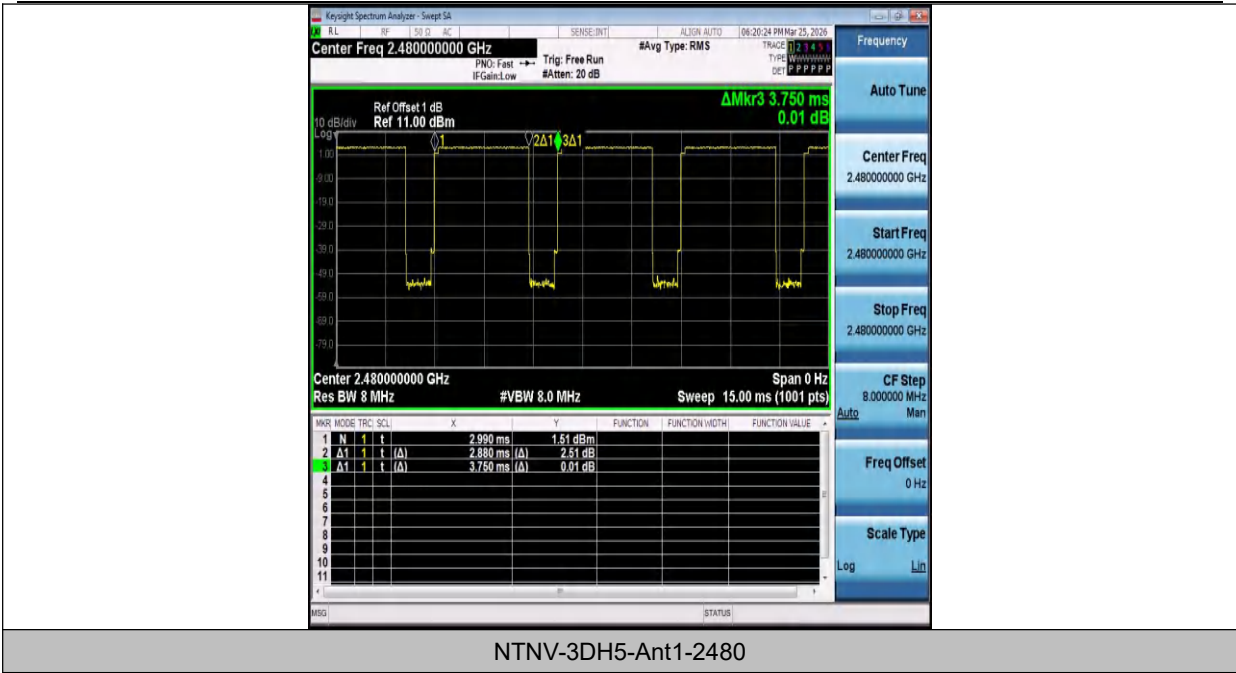

NTNV-3DH5-Ant1-2480

---End---