




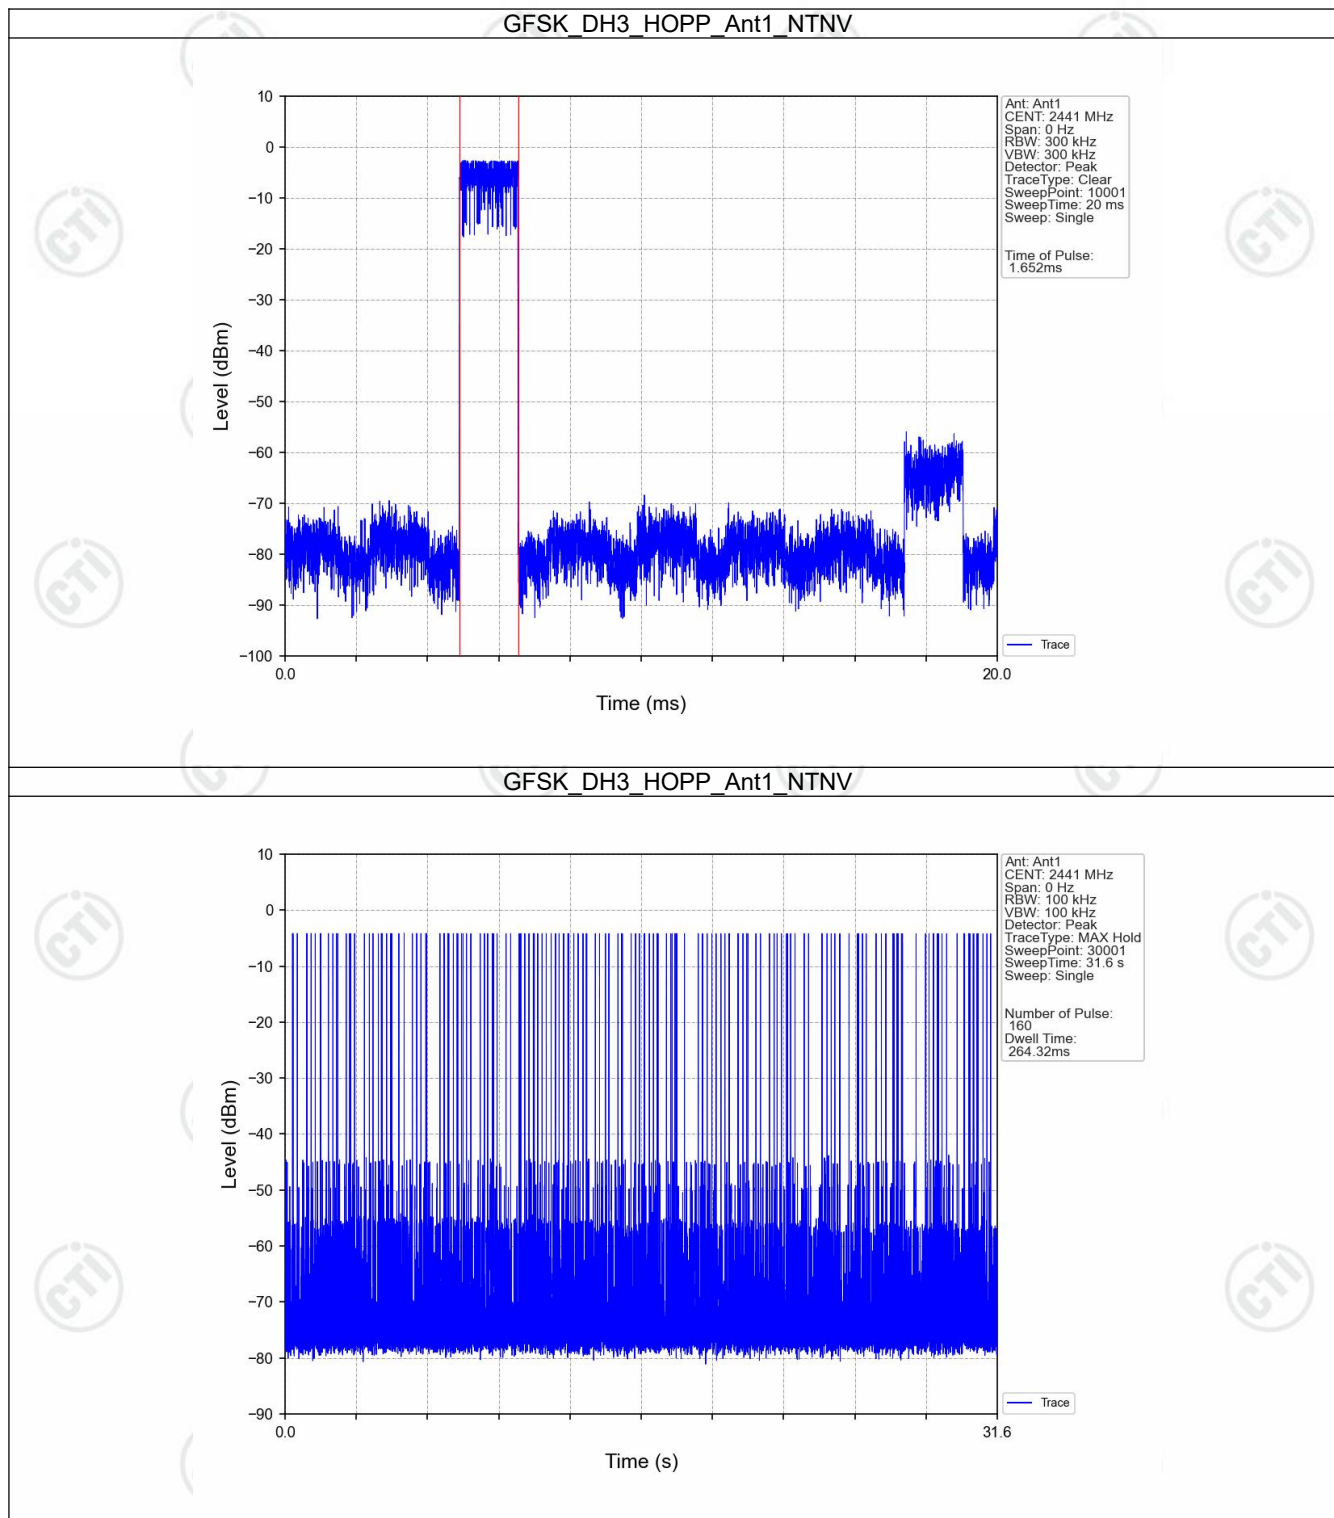


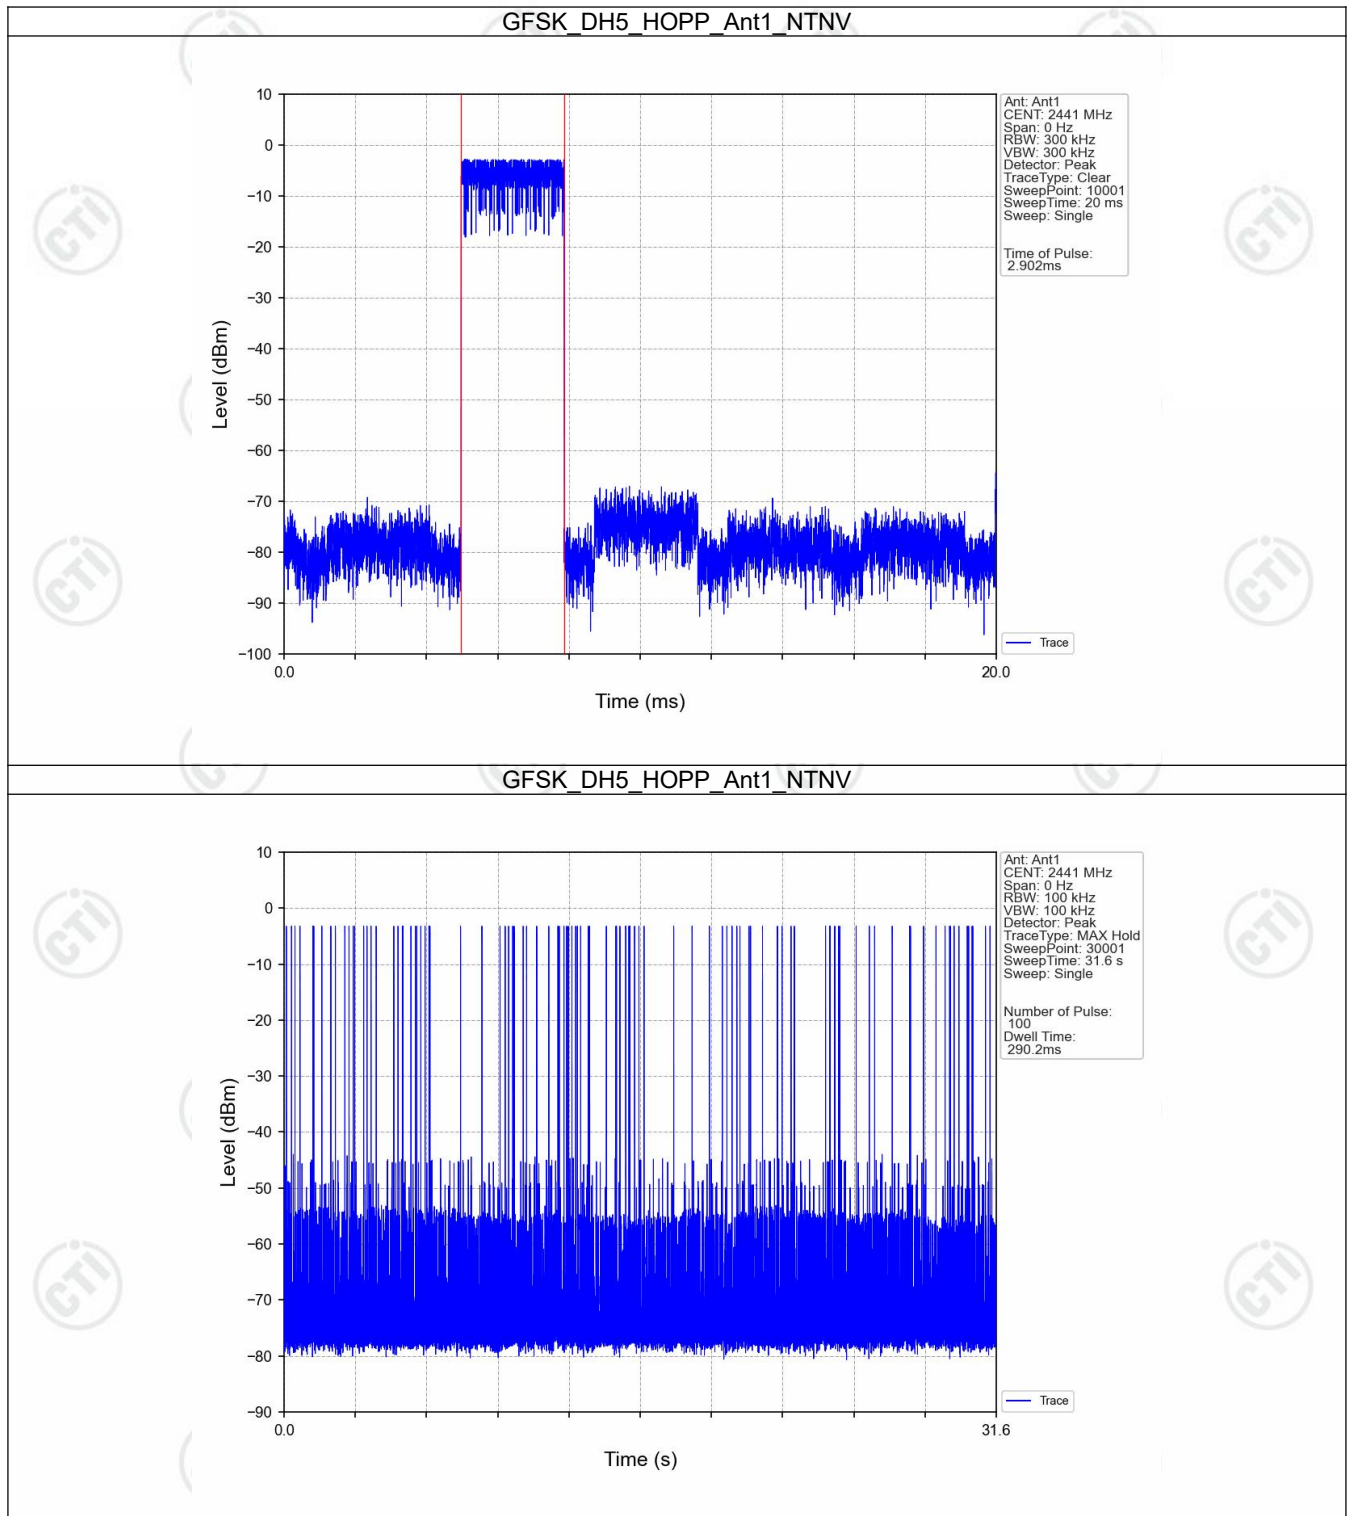


Pi/4DQPSK_2DH1_HOPP_Ant1_NTNV

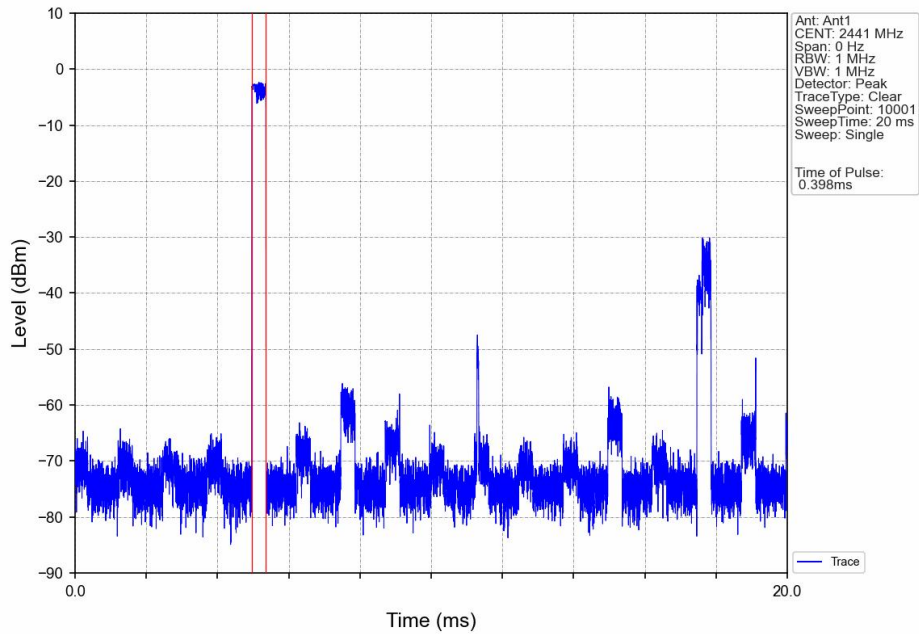


Pi/4DQPSK_2DH1_HOPP_Ant1_NTNV

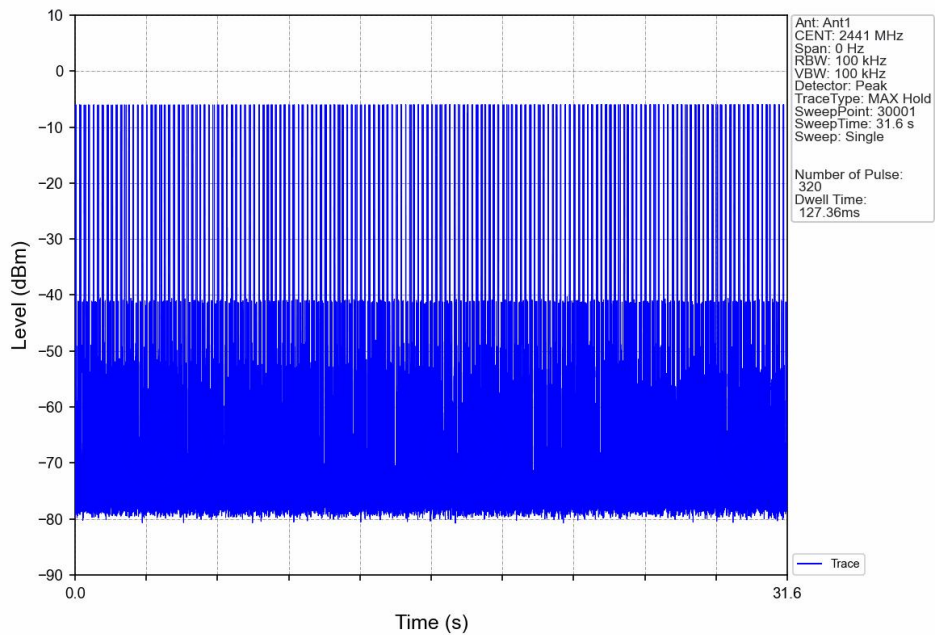


Pi/4DQPSK_2DH3_HOPP_Ant1_NTNV

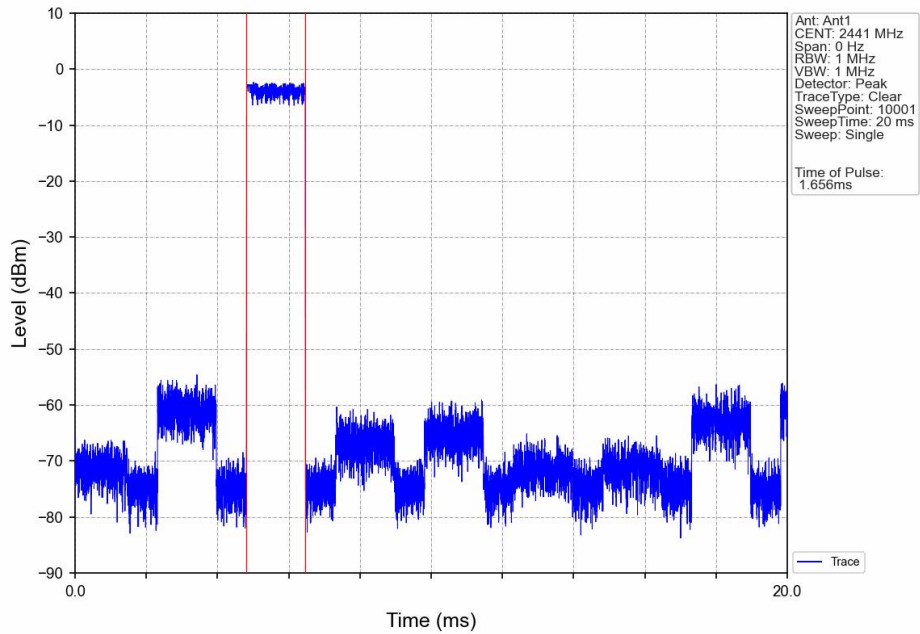


Pi/4DQPSK_2DH3_HOPP_Ant1_NTNV

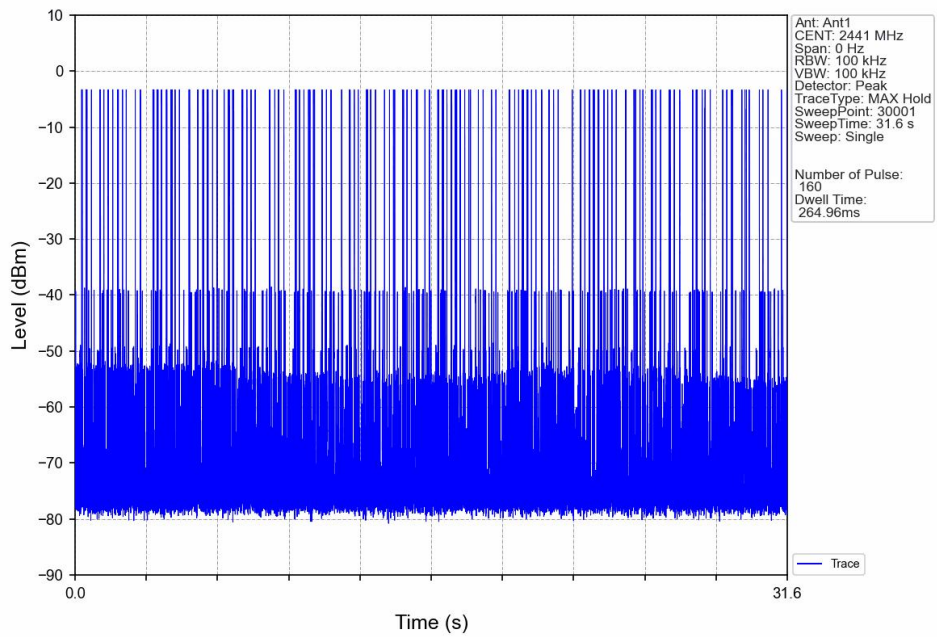


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

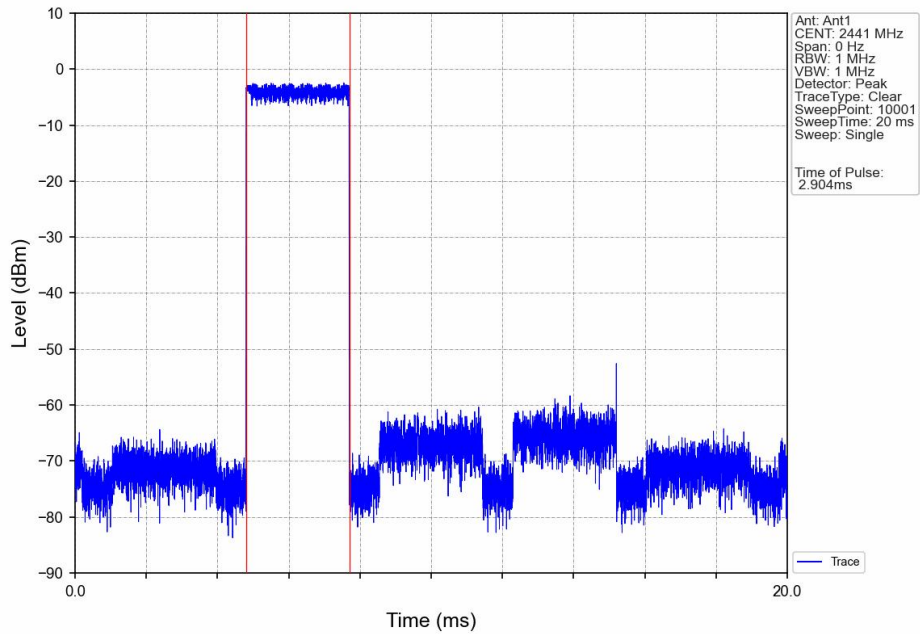


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

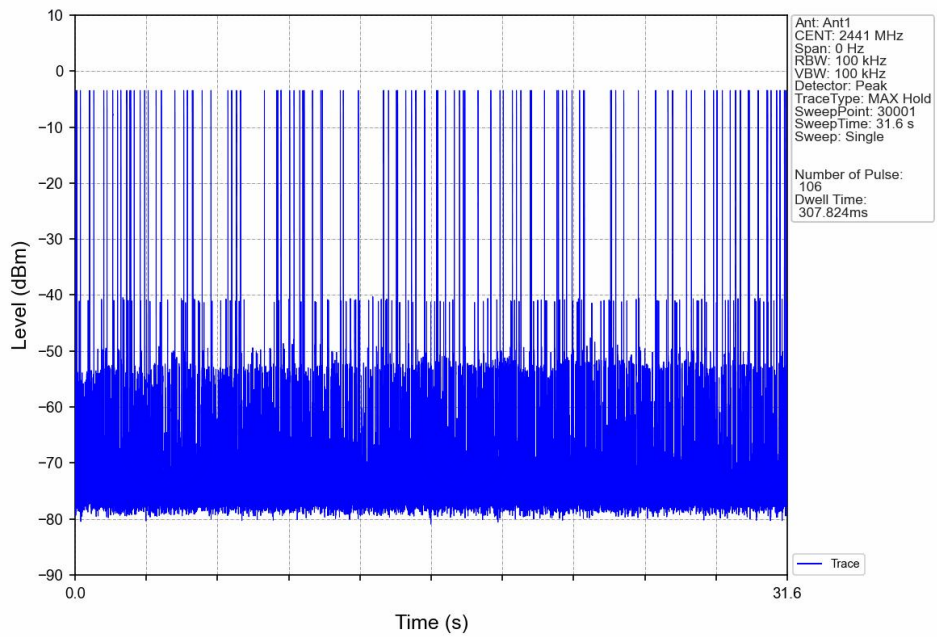


8DPSK_3DH1_HOPP_Ant1_NTNV

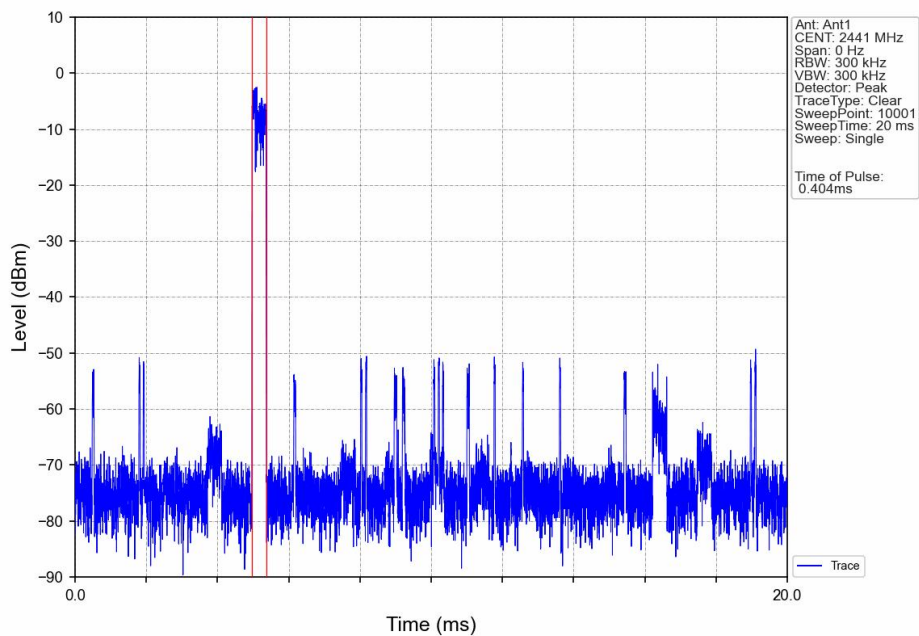


8DPSK_3DH1_HOPP_Ant1_NTNV

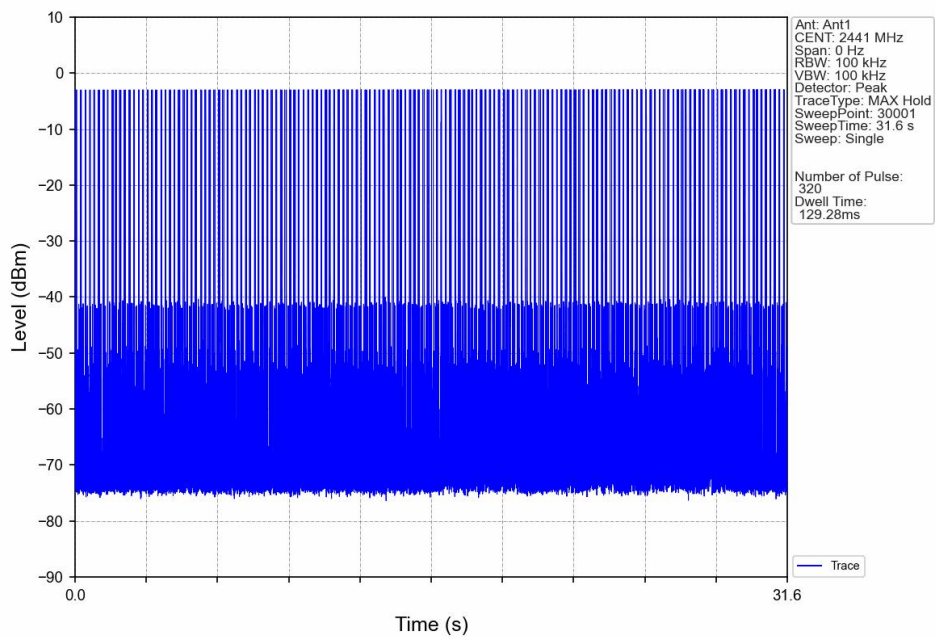


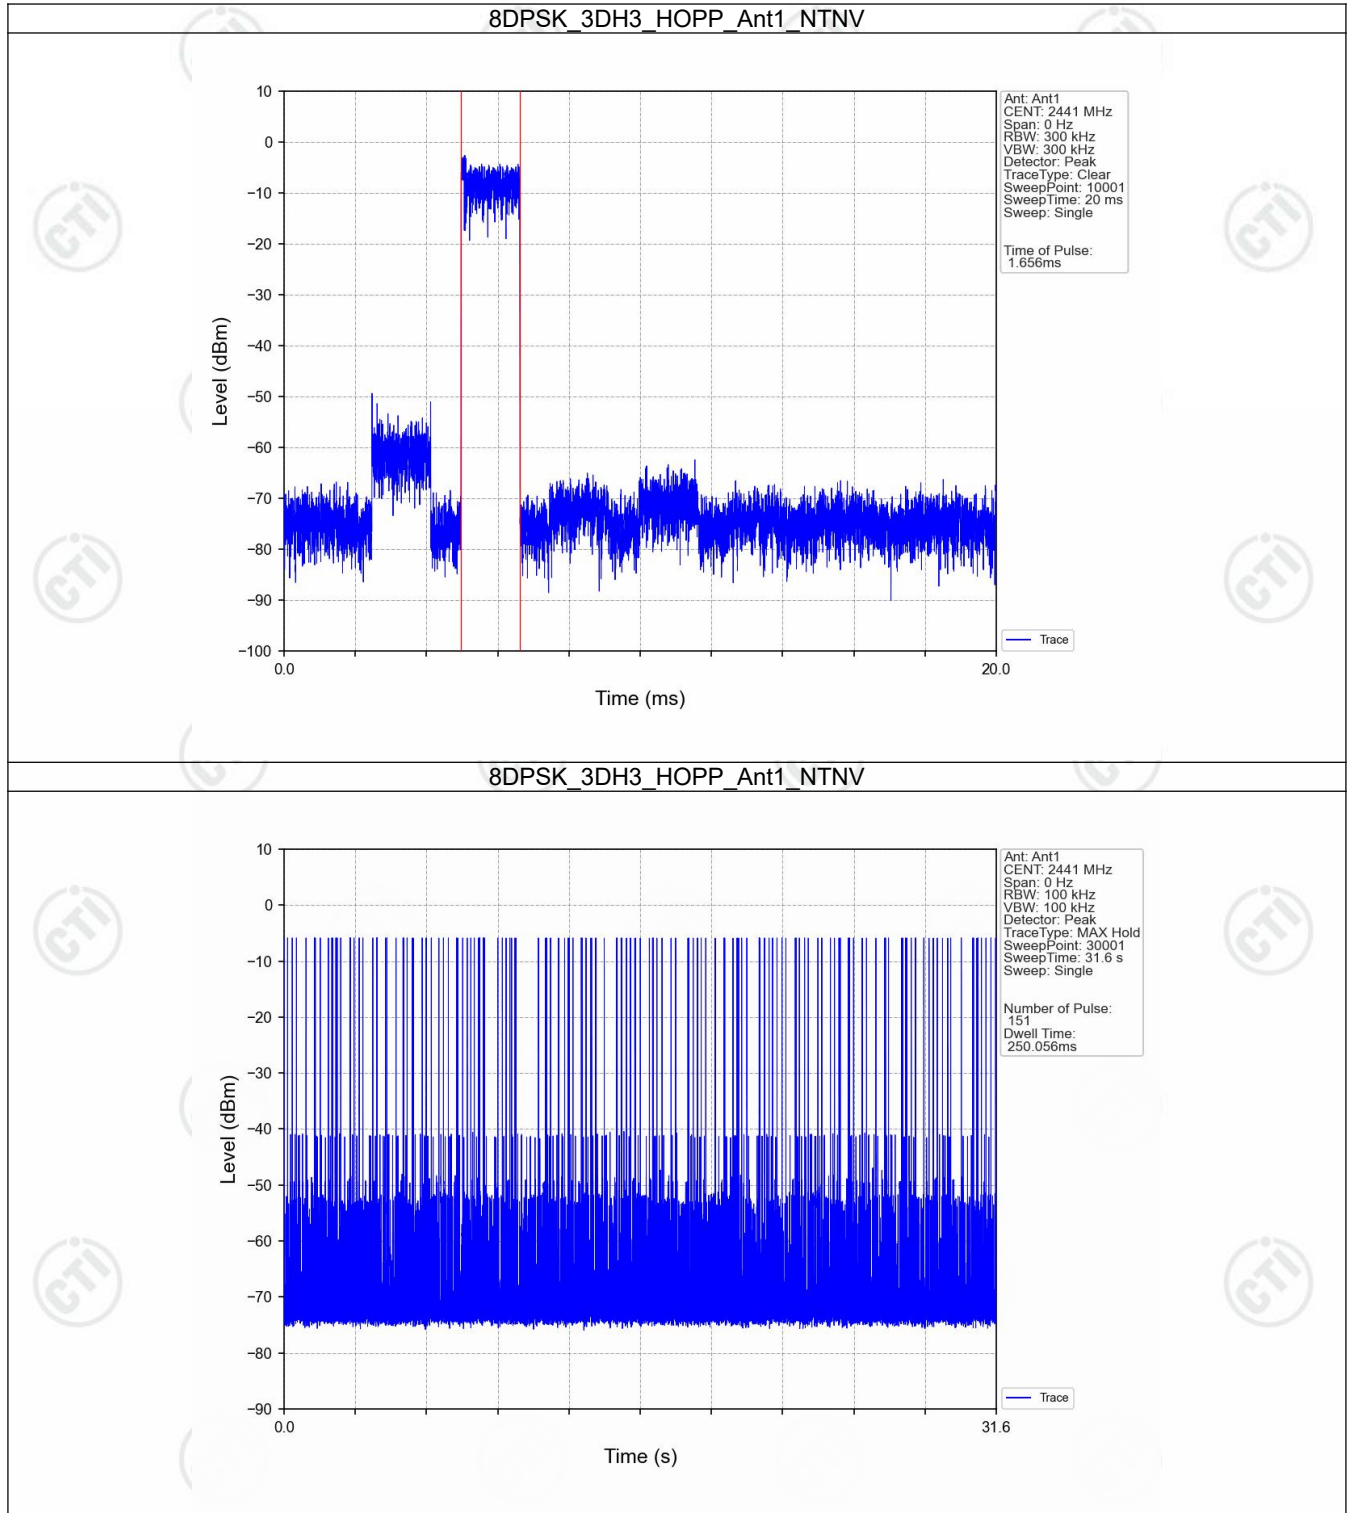

8DPSK_3DH5_HOPP_Ant1_NTNV

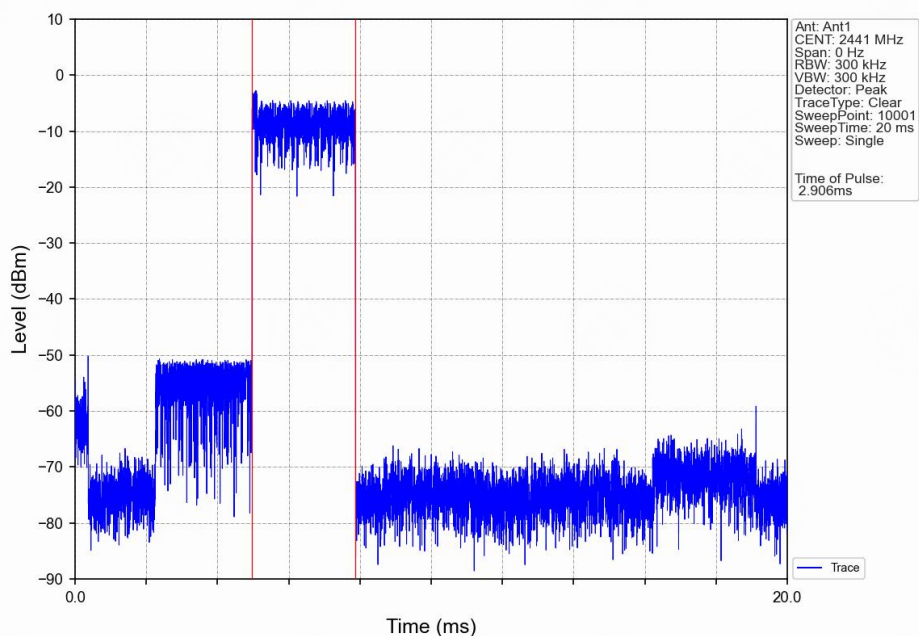

8DPSK_3DH5_HOPP_Ant1_NTNV

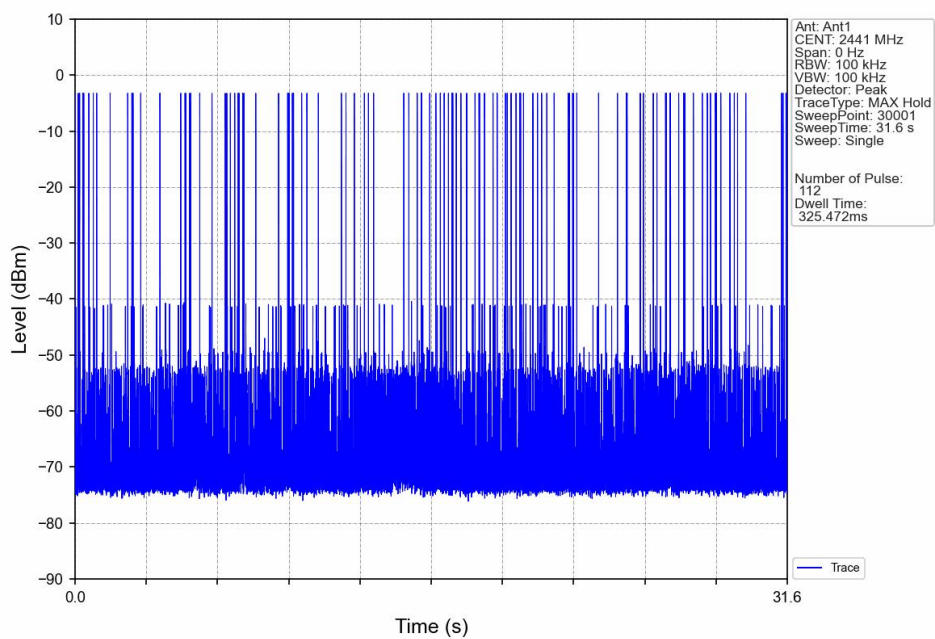

7. Unwanted Emissions In Non-restricted Frequency Bands

7.1 Test Result

7.1.1 Ref


Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)
GFSK	SISO	2402	DH5	1	-4.17
		2441	DH5	1	-3.11
		2480	DH5	1	-3.61
Pi/4DQPSK	SISO	2402	2DH5	1	-4.24
		2441	2DH5	1	-3.17
		2480	2DH5	1	-3.59
8DPSK	SISO	2402	3DH5	1	-4.13
		2441	3DH5	1	-3.12
		2480	3DH5	1	-3.59


7.1.2 CSE

Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)	Limit (dBm)	Verdict
GFSK	SISO	2402	DH5	1	-4.17	-24.17	Pass
		2441	DH5	1	-3.11	-23.11	Pass
		2480	DH5	1	-3.61	-23.61	Pass
		HOPP	DH5	1	-3.11	-23.11	Pass
					-3.11	-23.11	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	-4.24	-24.24	Pass
		2441	2DH5	1	-3.17	-23.17	Pass
		2480	2DH5	1	-3.59	-23.59	Pass
		HOPP	2DH5	1	-3.17	-23.17	Pass
					-3.17	-23.17	Pass
8DPSK	SISO	2402	3DH5	1	-4.13	-24.13	Pass
		2441	3DH5	1	-3.12	-23.12	Pass
		2480	3DH5	1	-3.59	-23.59	Pass
		HOPP	3DH5	1	-3.12	-23.12	Pass
					-3.12	-23.12	Pass


7.2 Test Graph

7.2.1 Ref

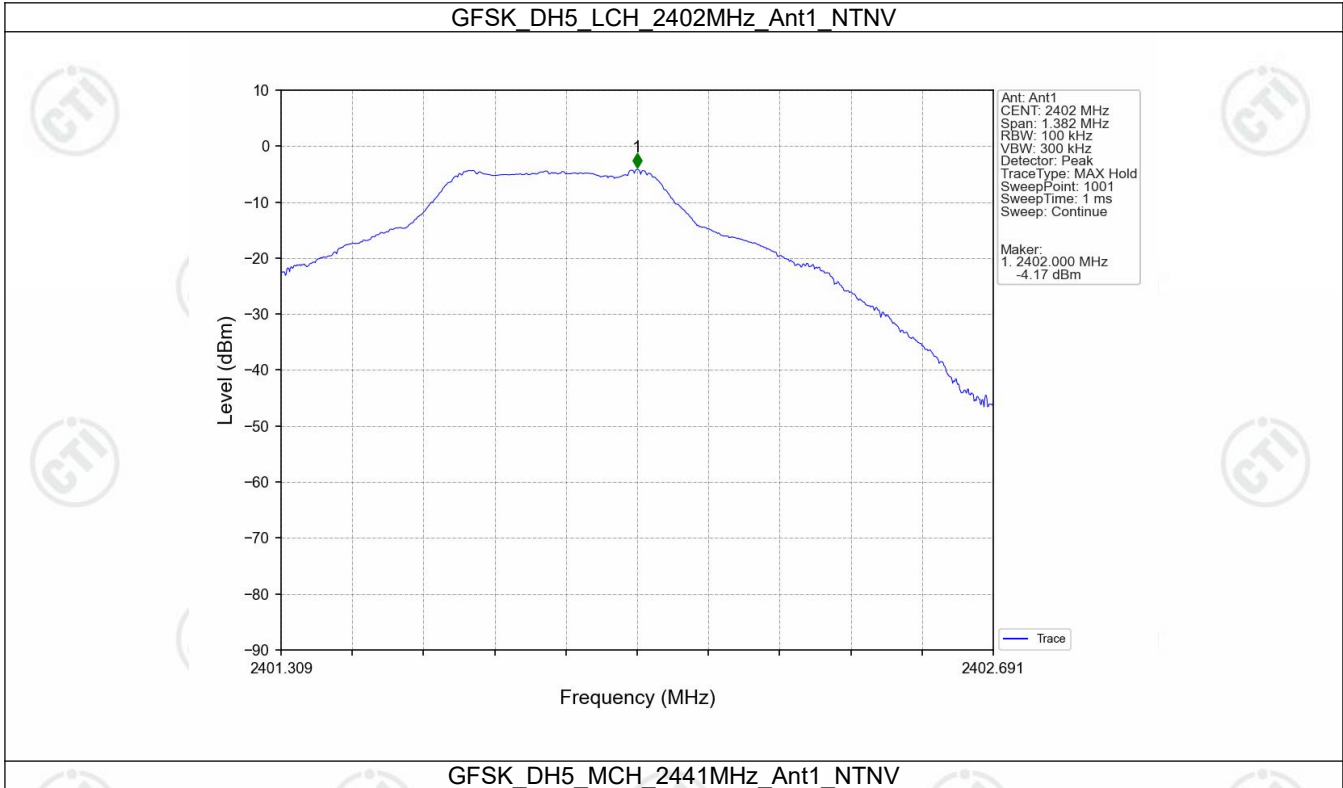


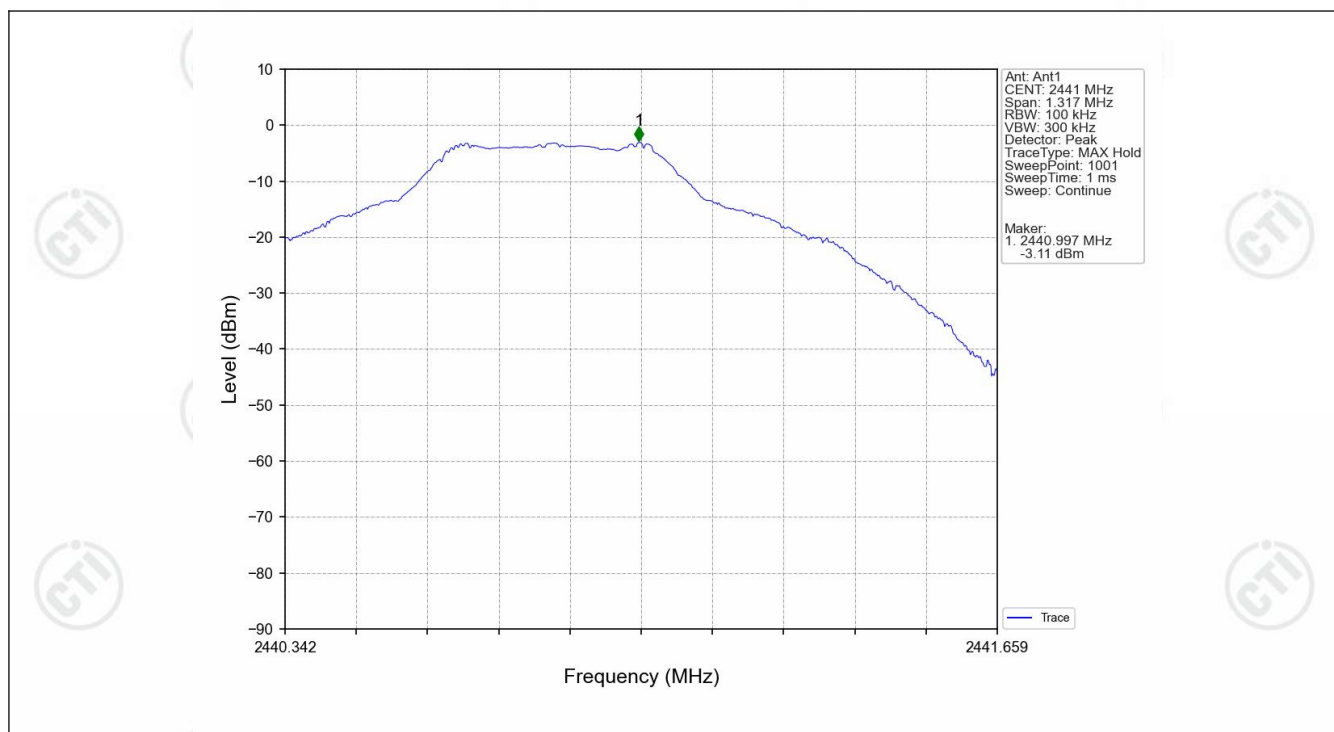


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

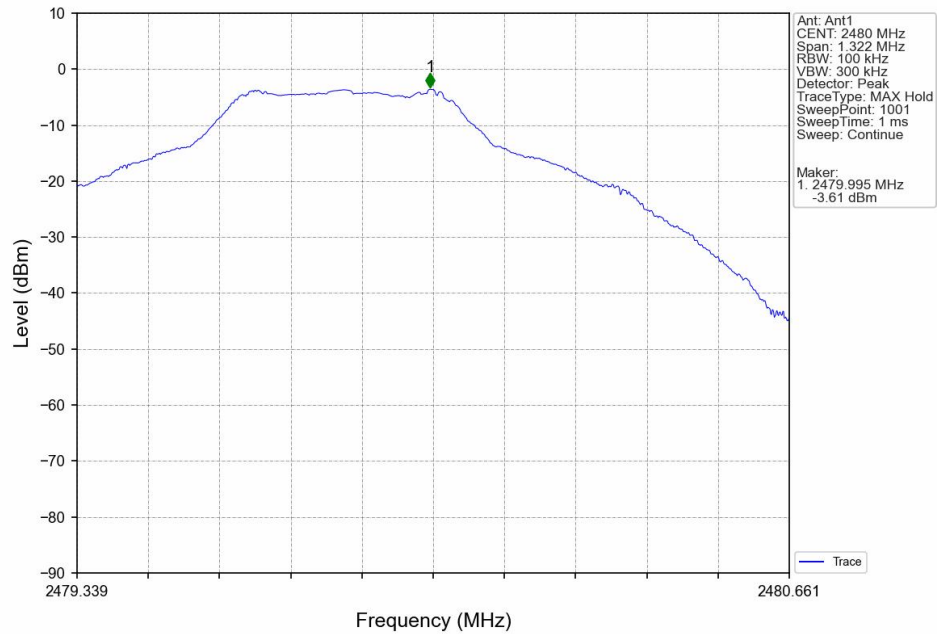


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

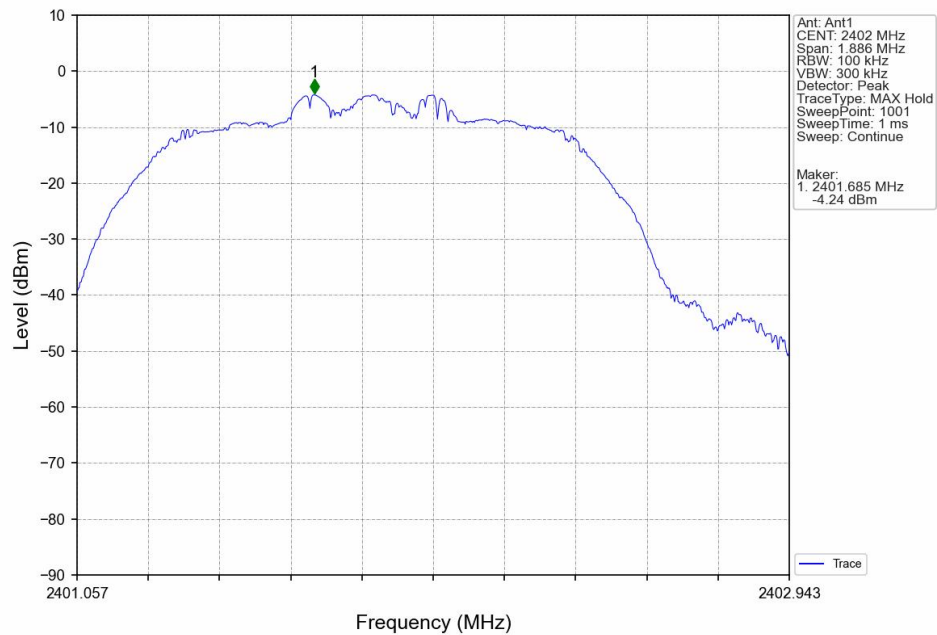


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

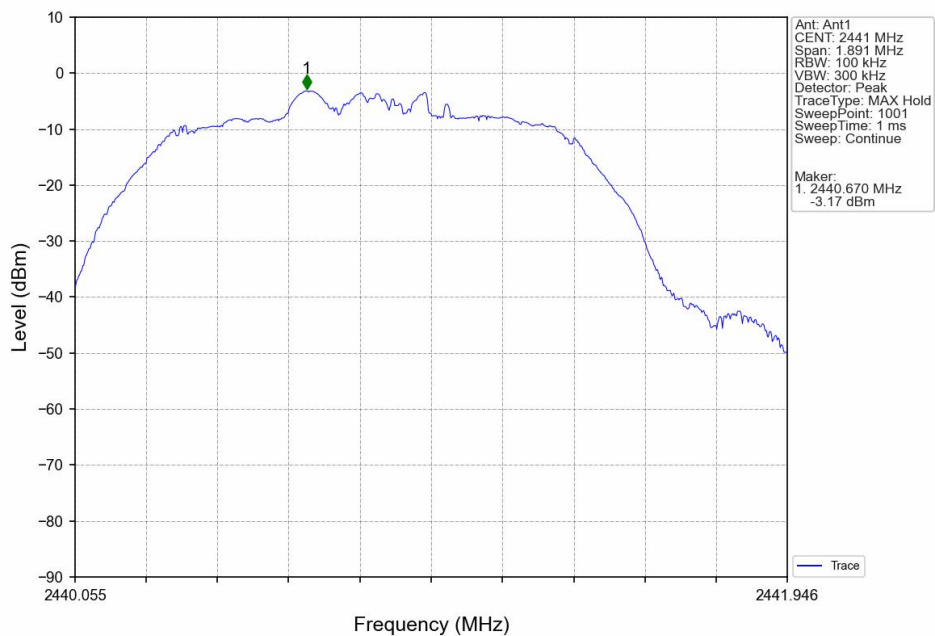


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

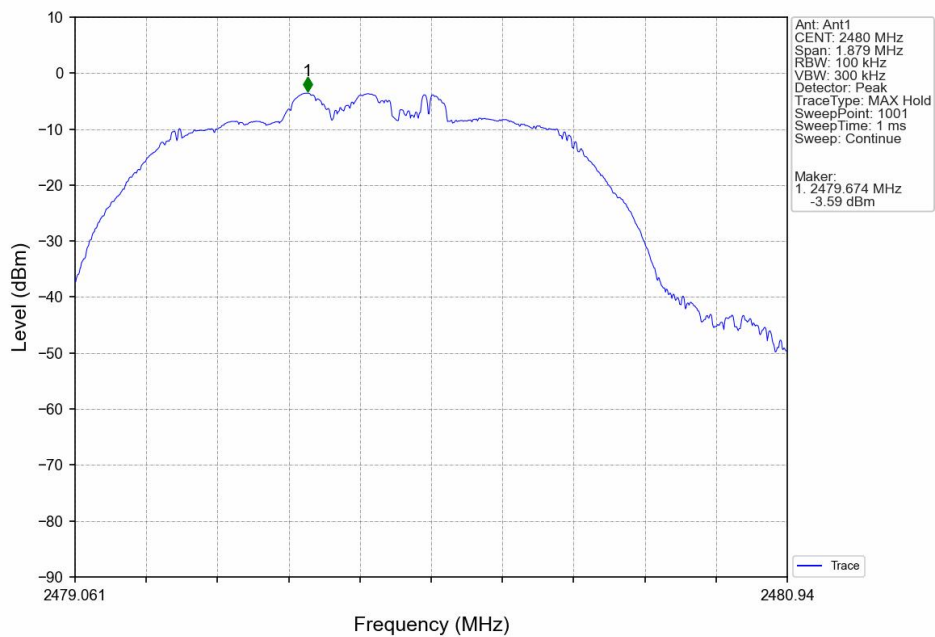


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

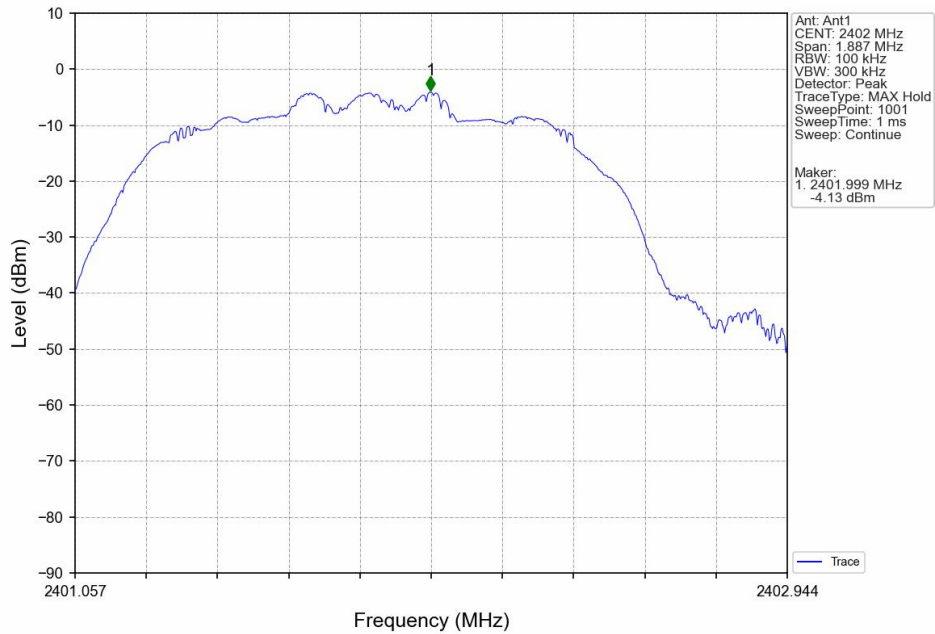

8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

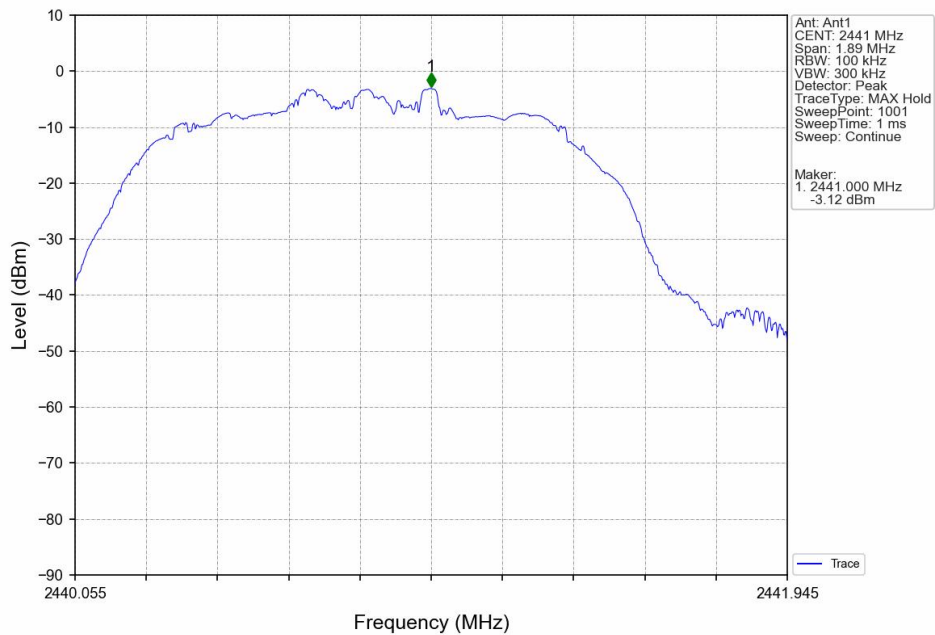

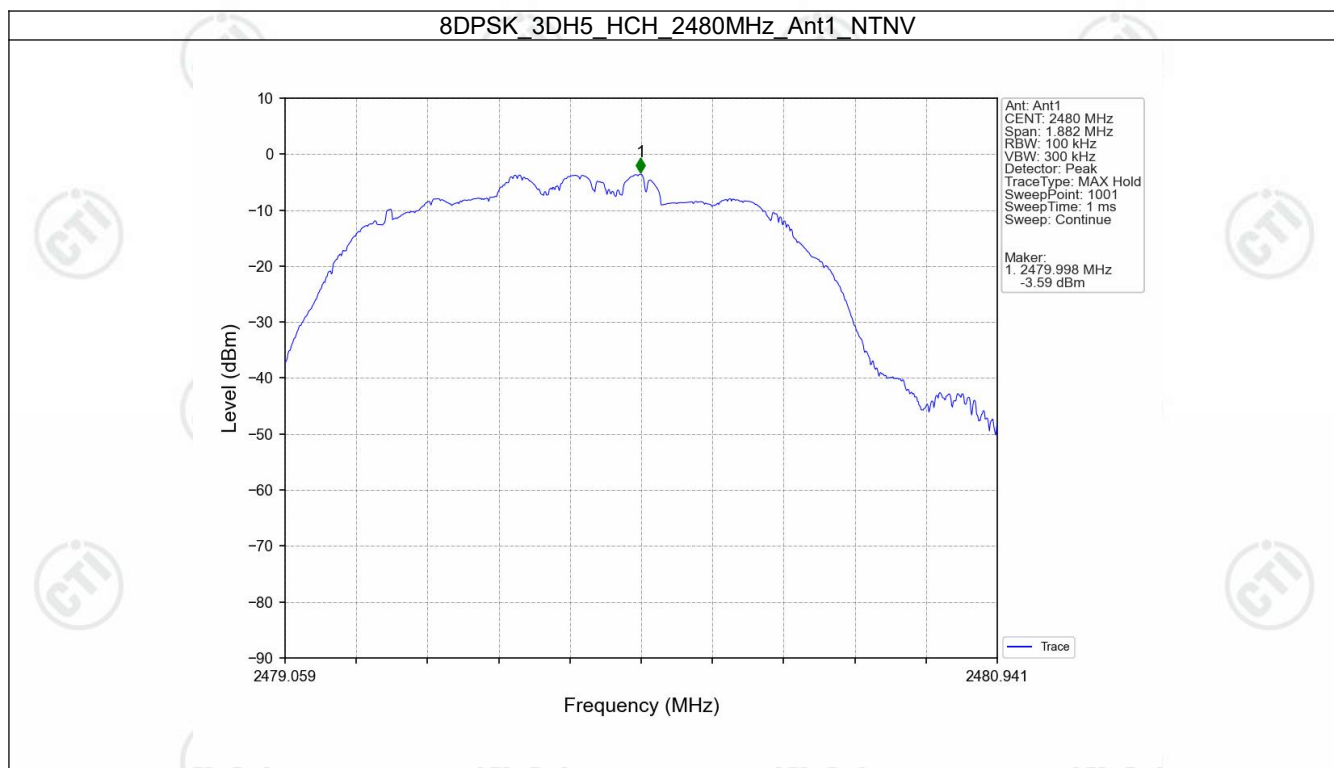

7.2.2 CSE

