





SGS-CSTC Standards Technical Services Co., Ltd. Guangzhou Branch



Report No.: GZEM181100248301
Page: 61 of 118

Dwell Time_DH3_2441

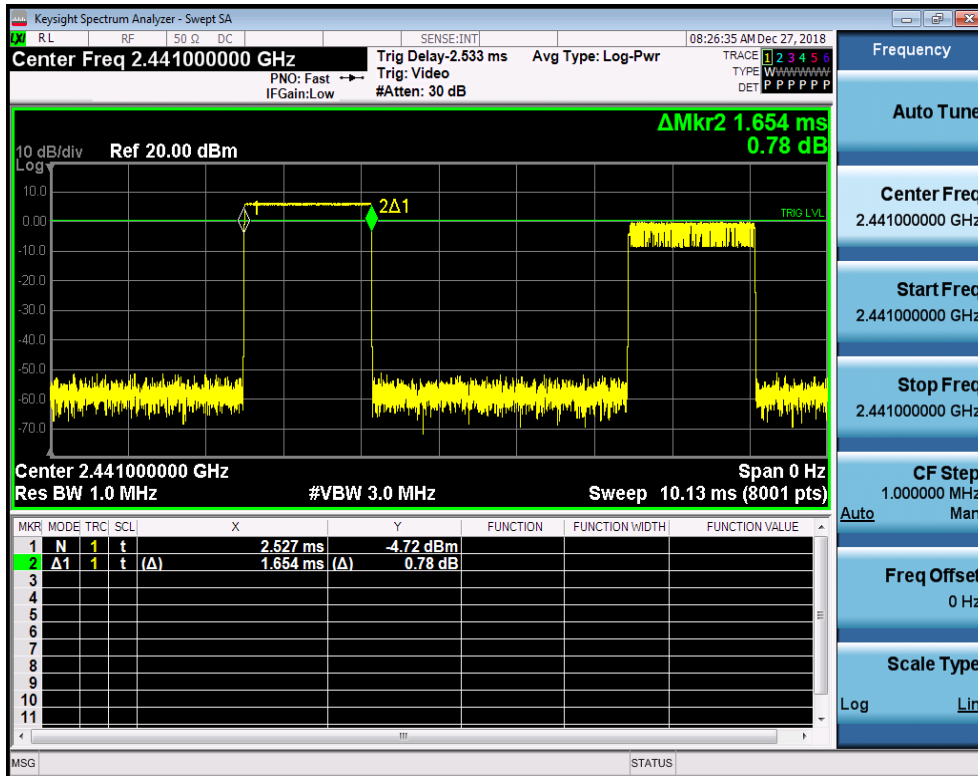

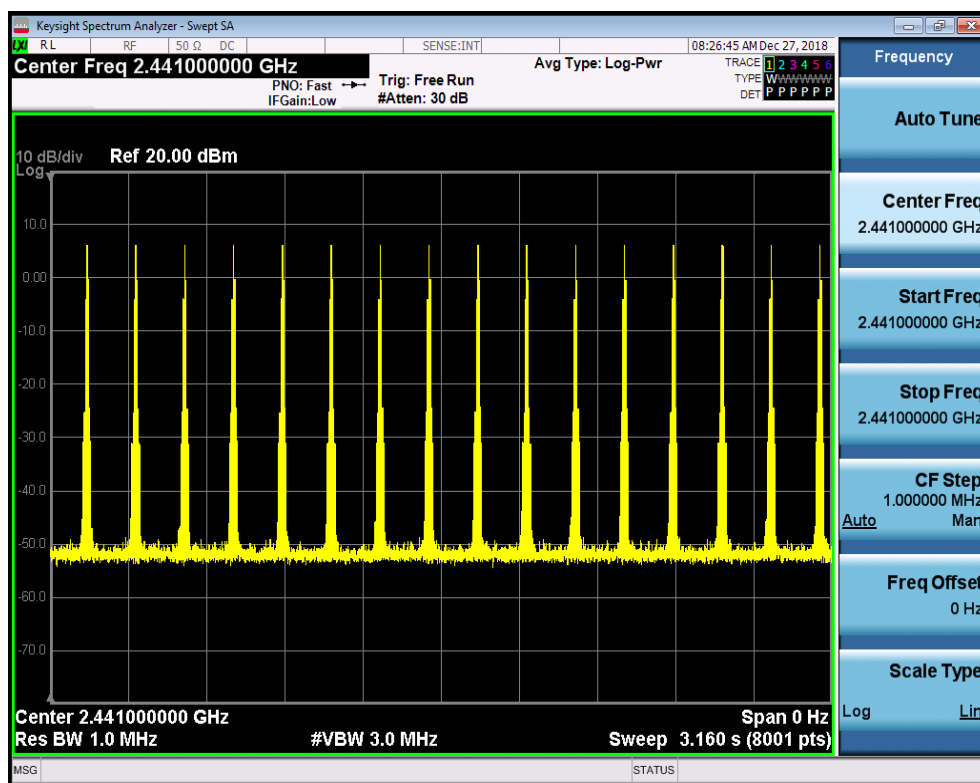

Dwell Time_DH3_2480

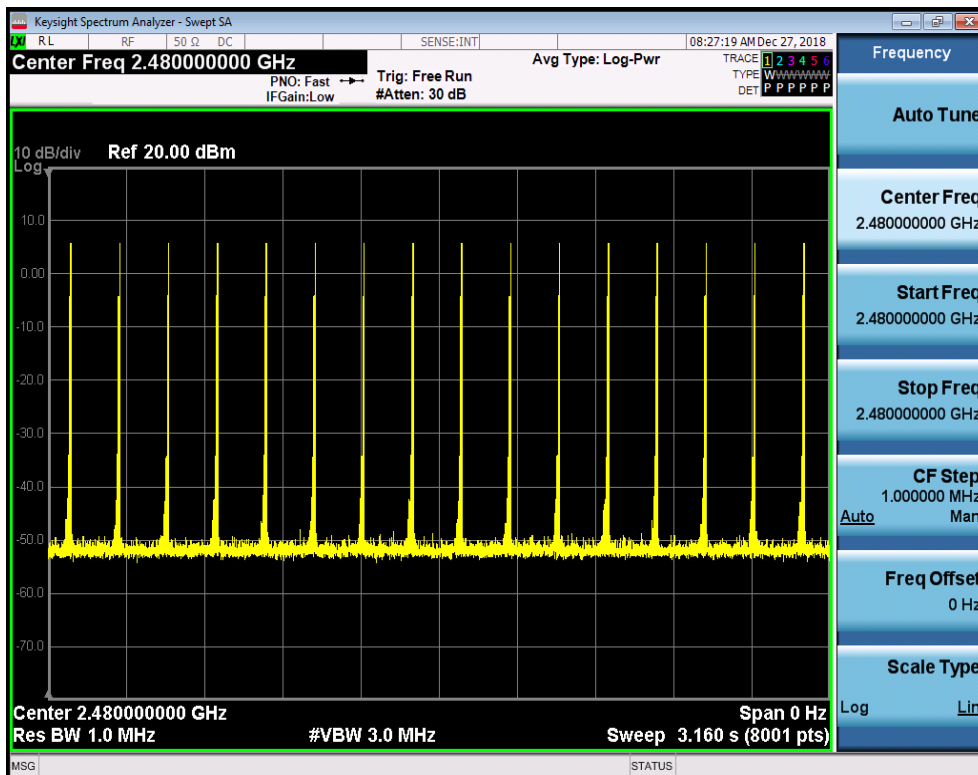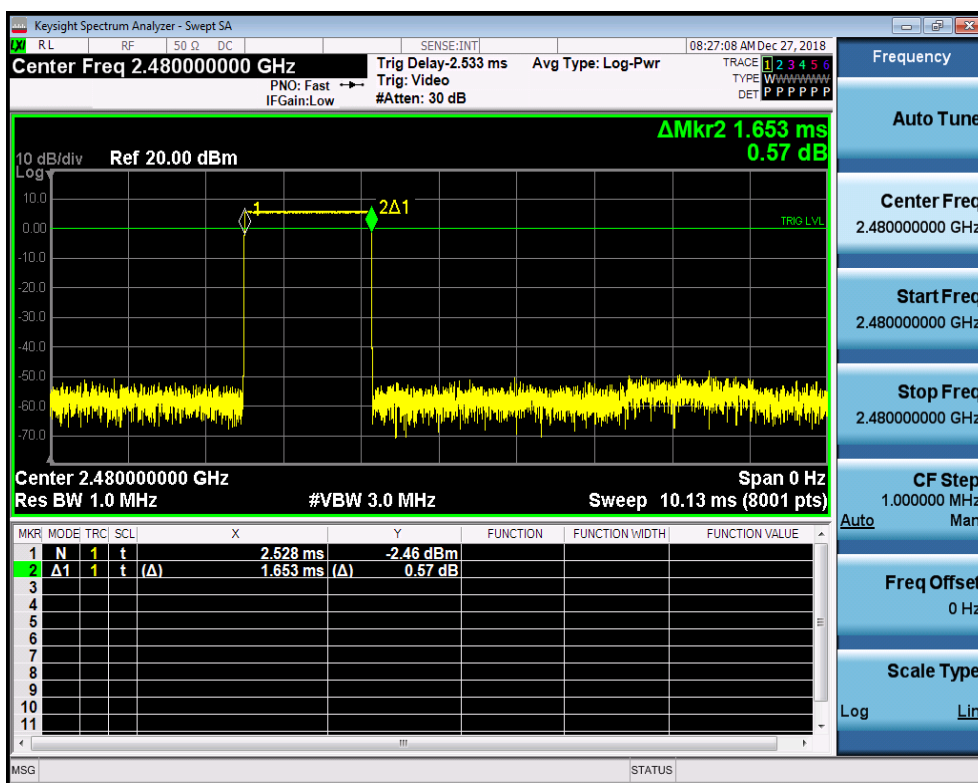




SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch

Report No.: GZEM181100248301
Page: 64 of 118


Dwell Time_DH5_2402

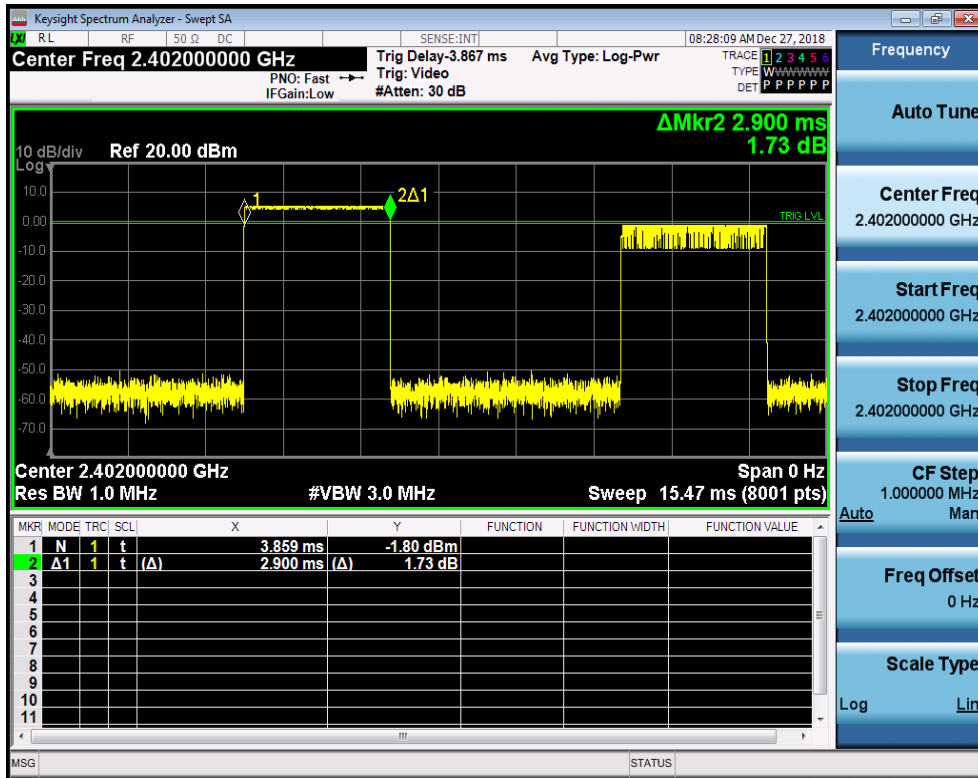





SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch

Report No.: GZEM181100248301
Page: 65 of 118

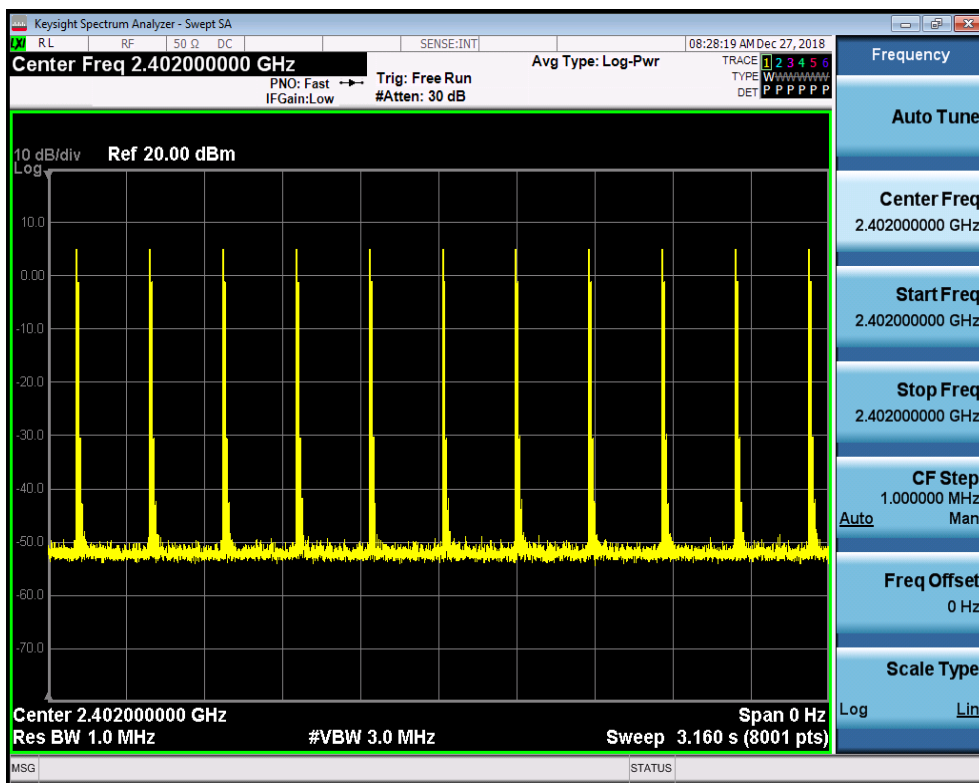

Dwell Time_DH5_2441

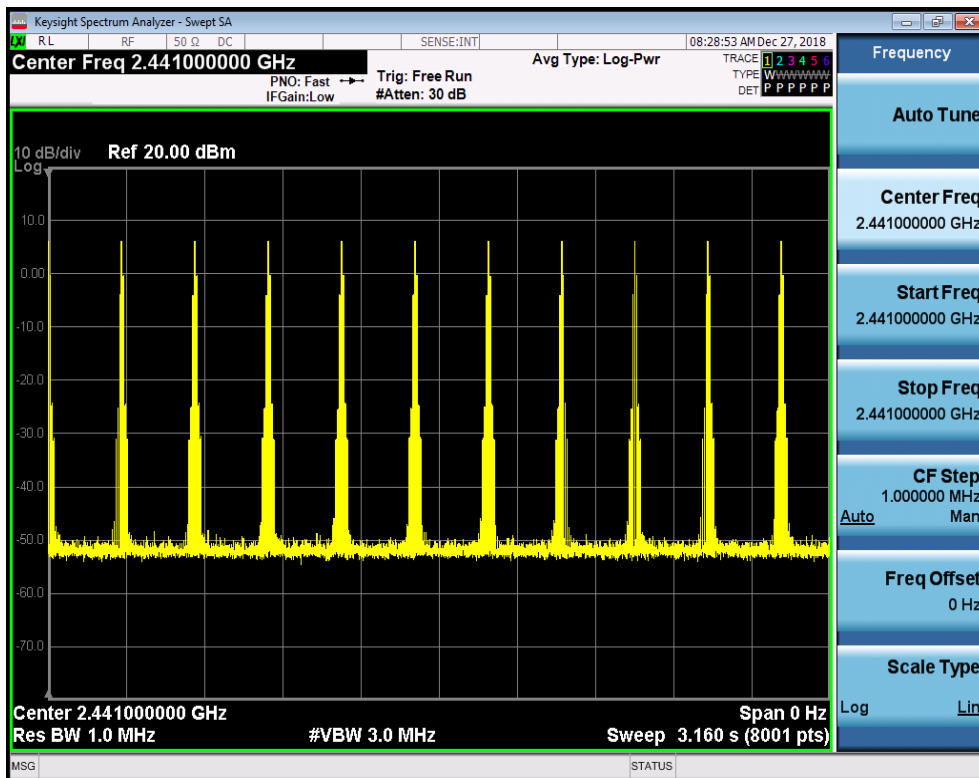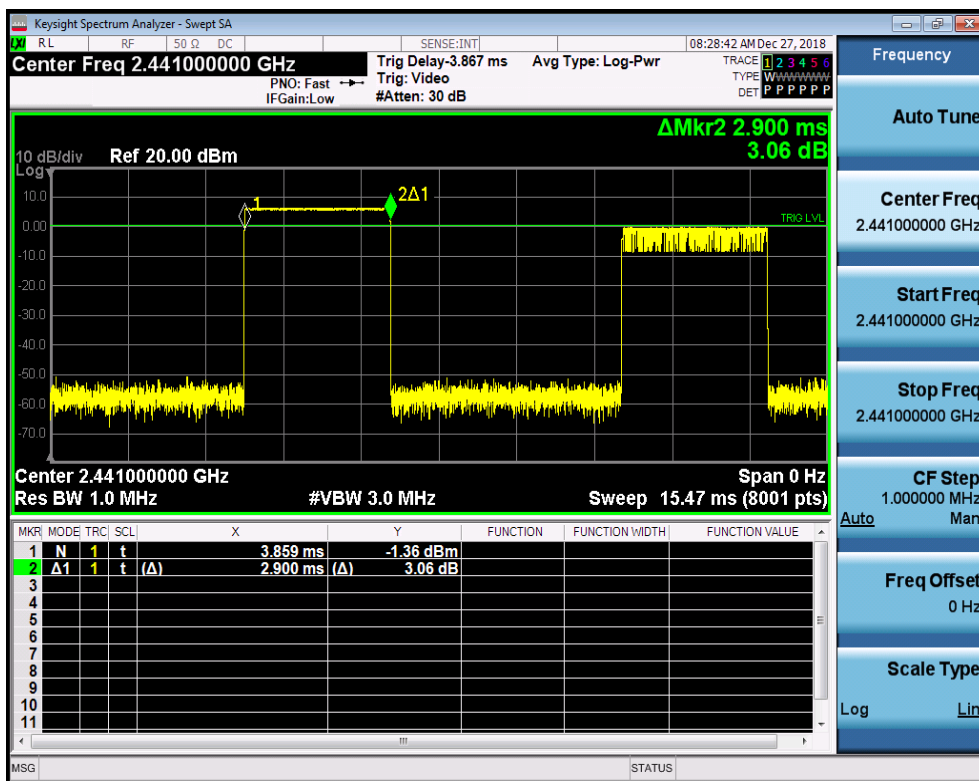





SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch



Report No.: GZEM181100248301
Page: 67 of 118

Dwell Time_DH5_2480

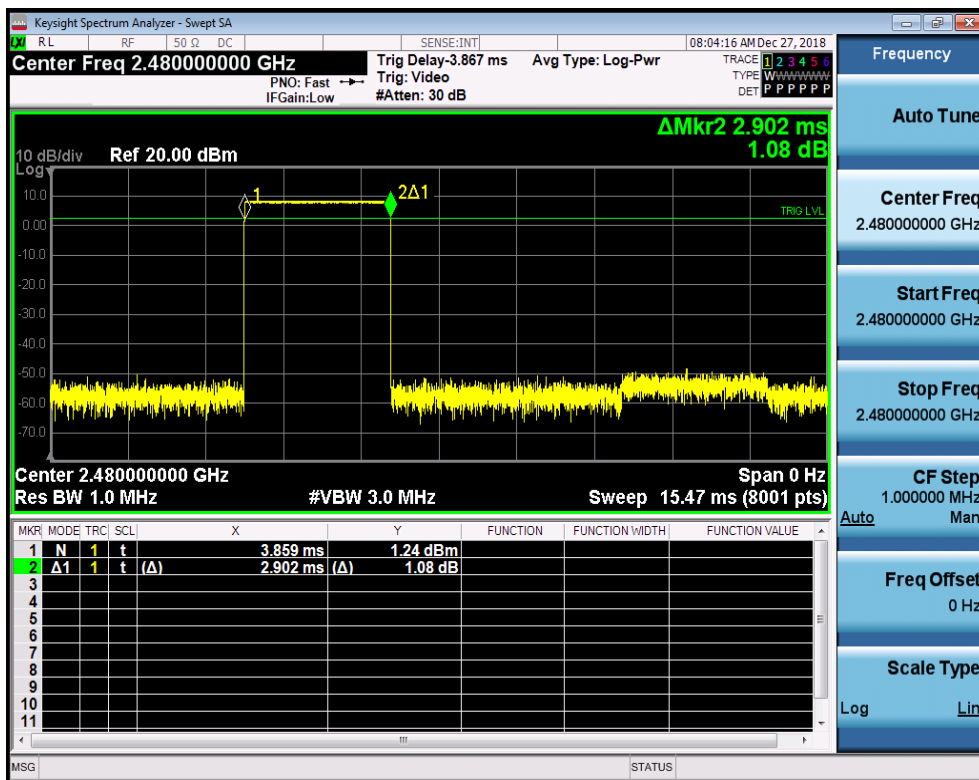

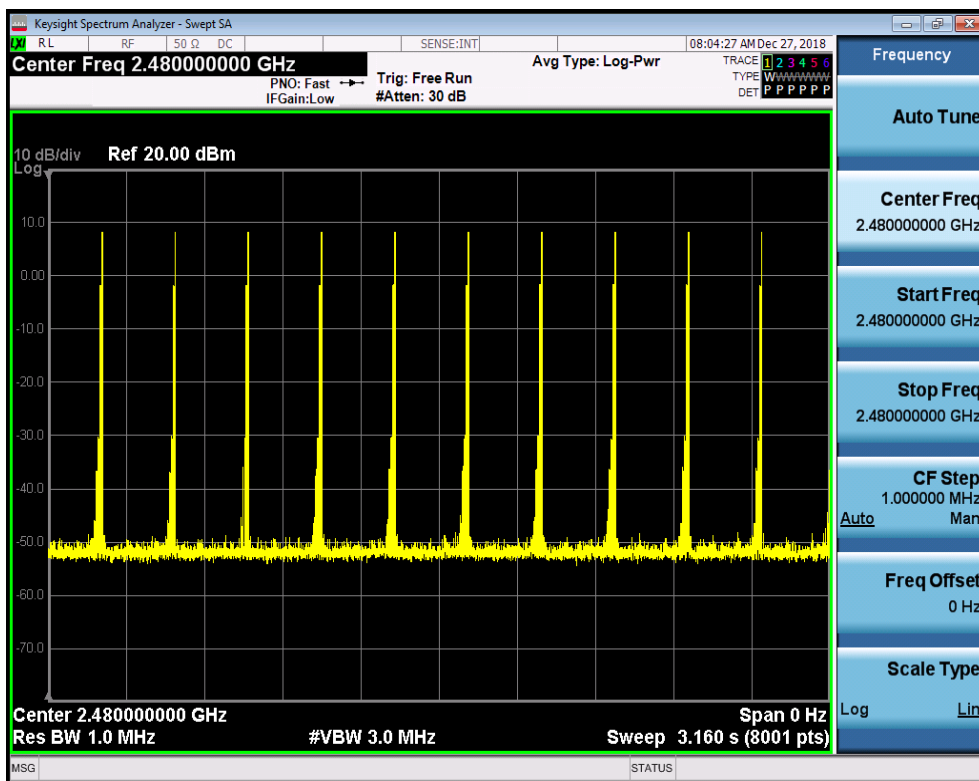

Dwell Time_2DH1_2402

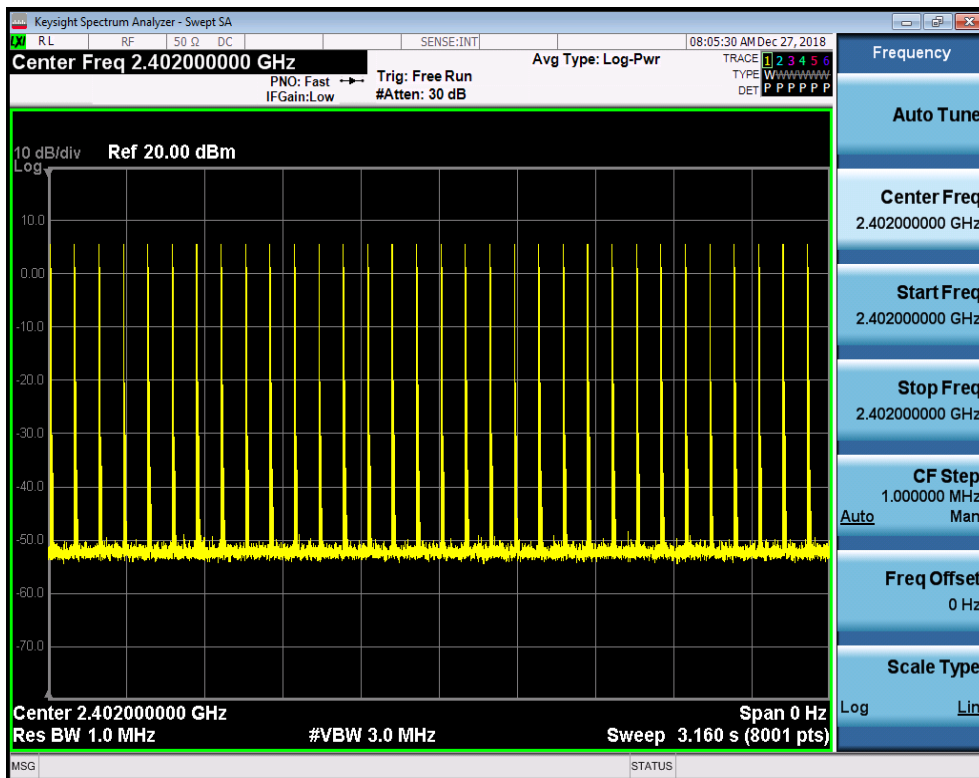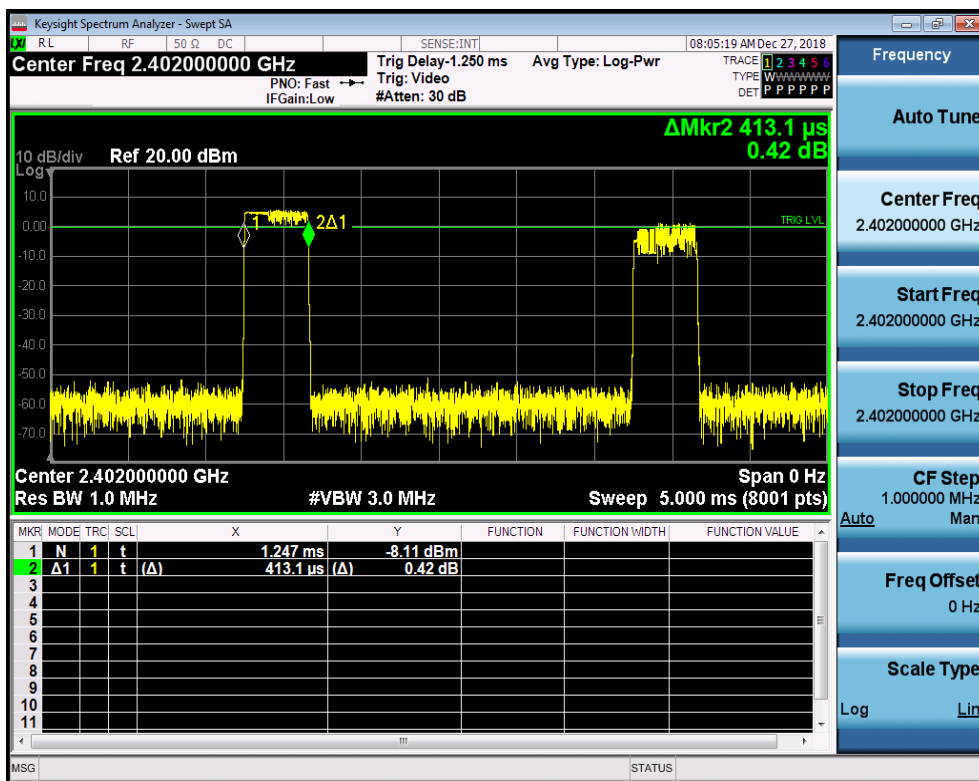






SGS-CSTC Standards Technical Services Co., Ltd. Guangzhou Branch

Report No.: GZEM181100248301
Page: 70 of 118

Dwell Time_2DH1_2441

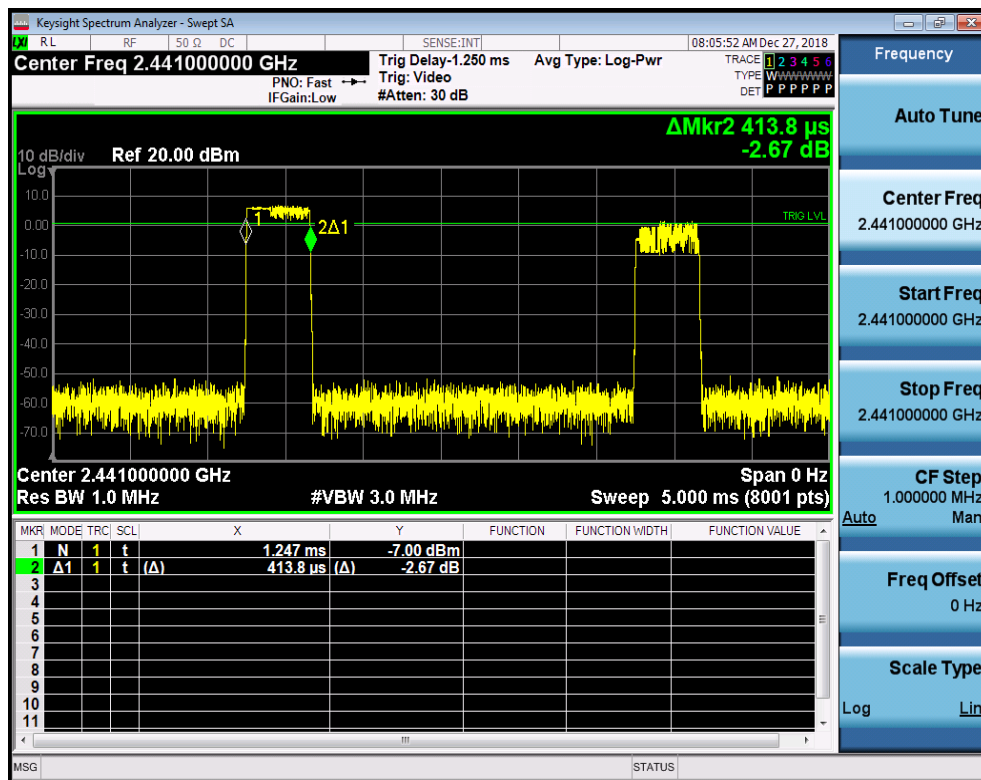

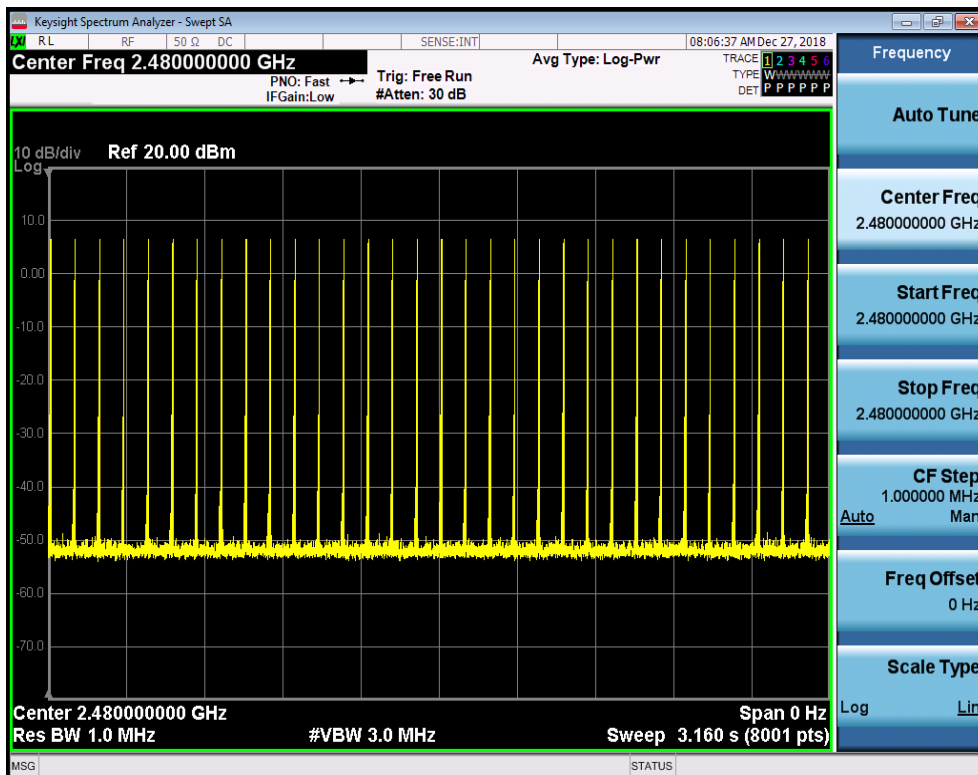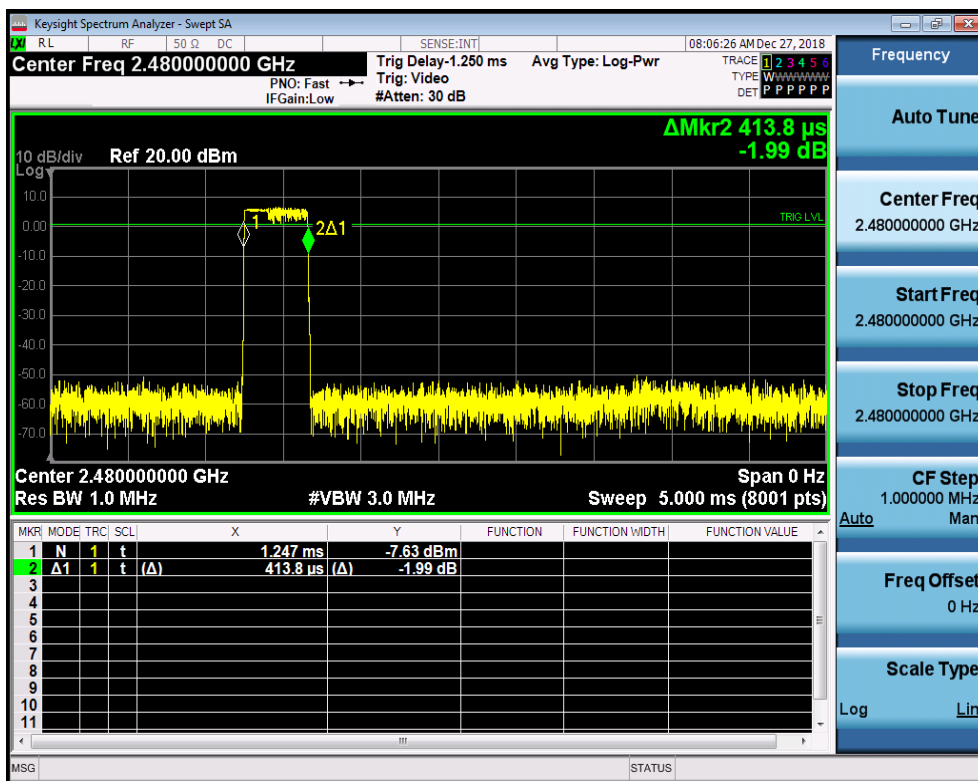





SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch



Report No.: GZEM181100248301
Page: 73 of 118

Dwell Time_2DH3_2402

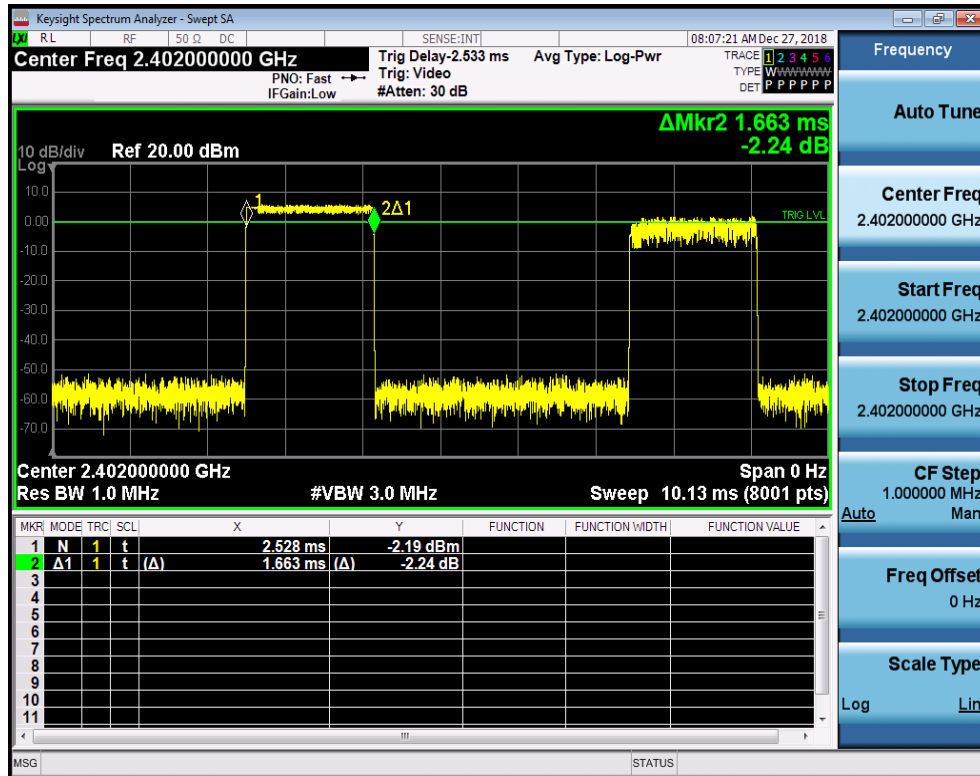

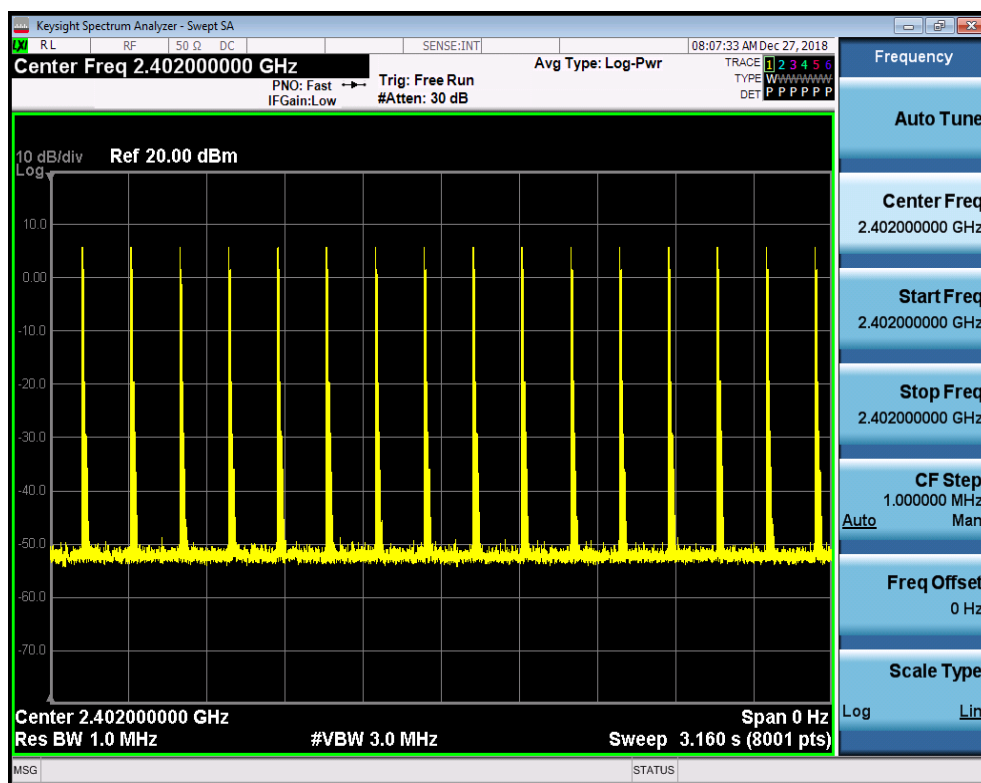

Dwell Time_2DH3_2441

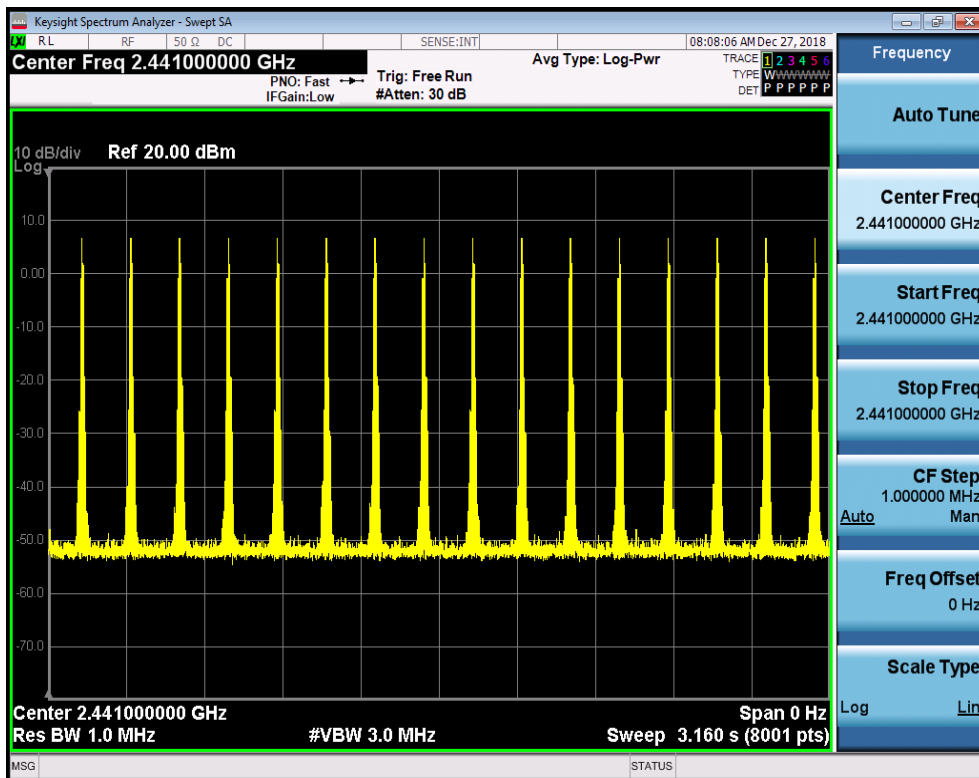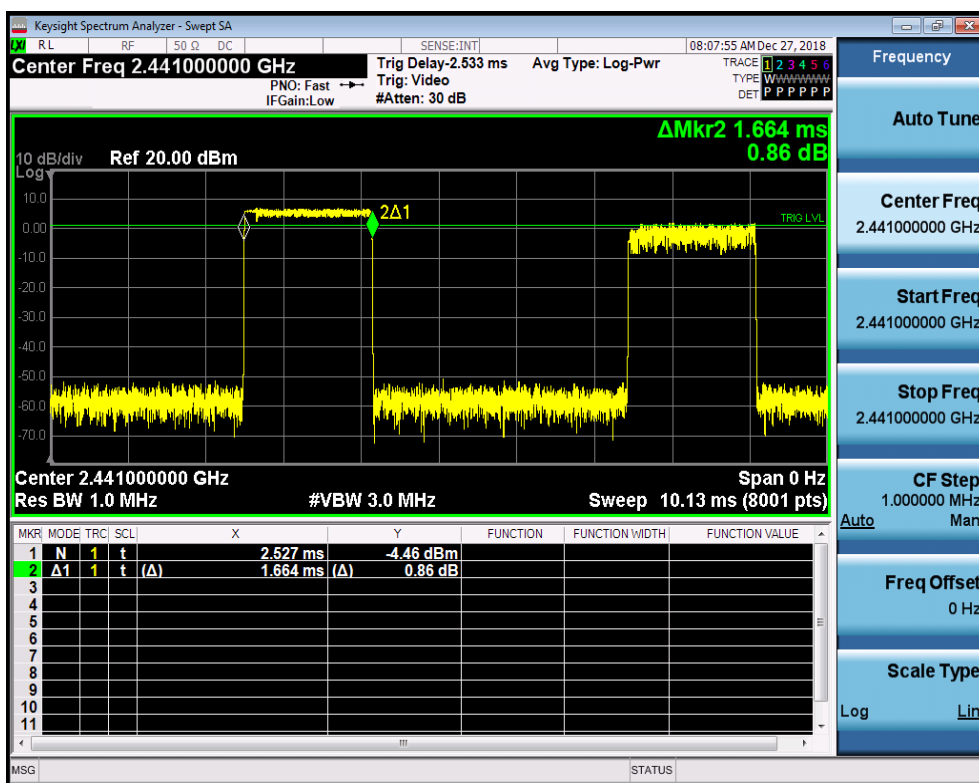





SGS-CSTC Standards Technical Services Co., Ltd. Guangzhou Branch

Report No.: GZEM181100248301
Page: 76 of 118

Dwell Time_2DH3_2480

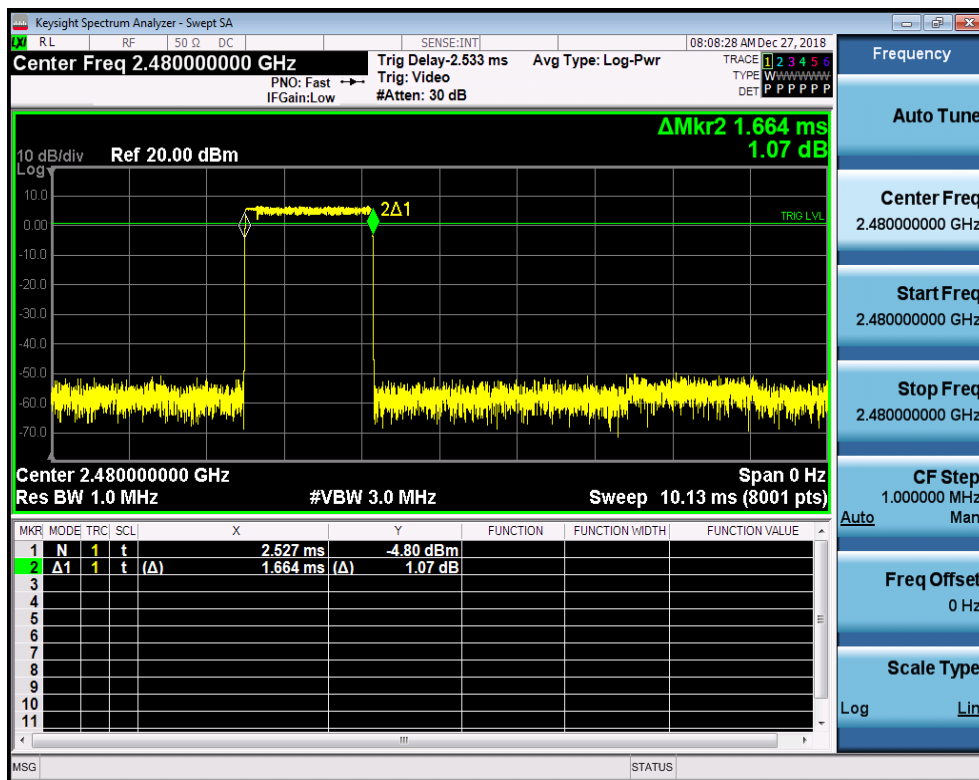


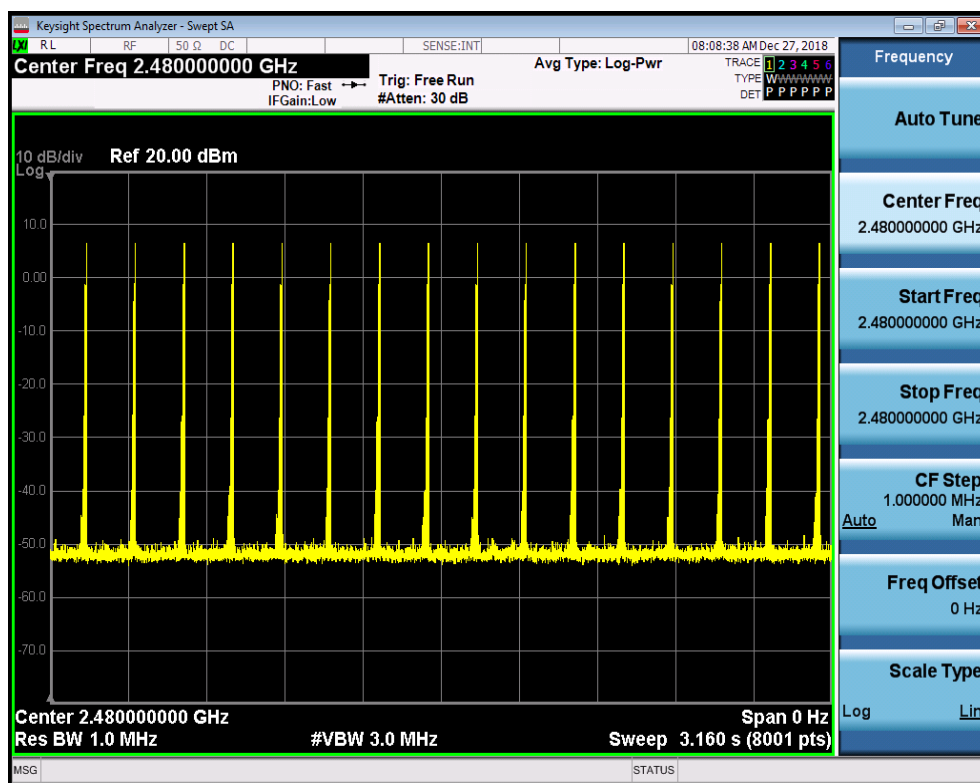


Dwell Time_2DH5_2402



SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch

Report No.: GZEM181100248301
Page: 78 of 118

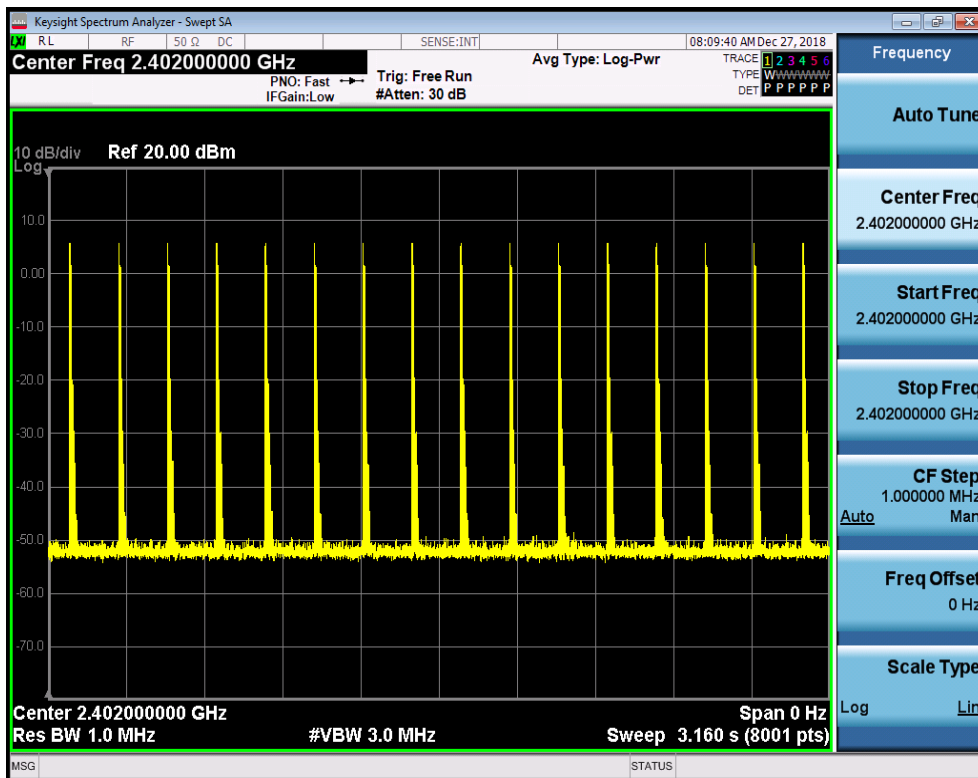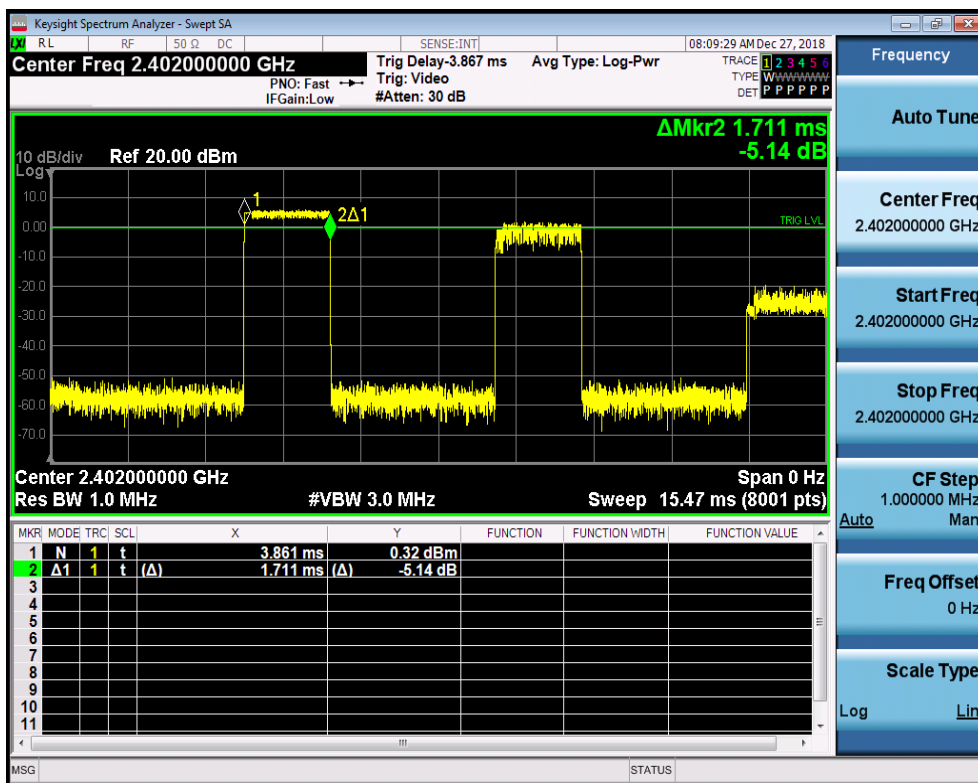




SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch

Report No.: GZEM181100248301
Page: 79 of 118


Dwell Time_2DH5_2441

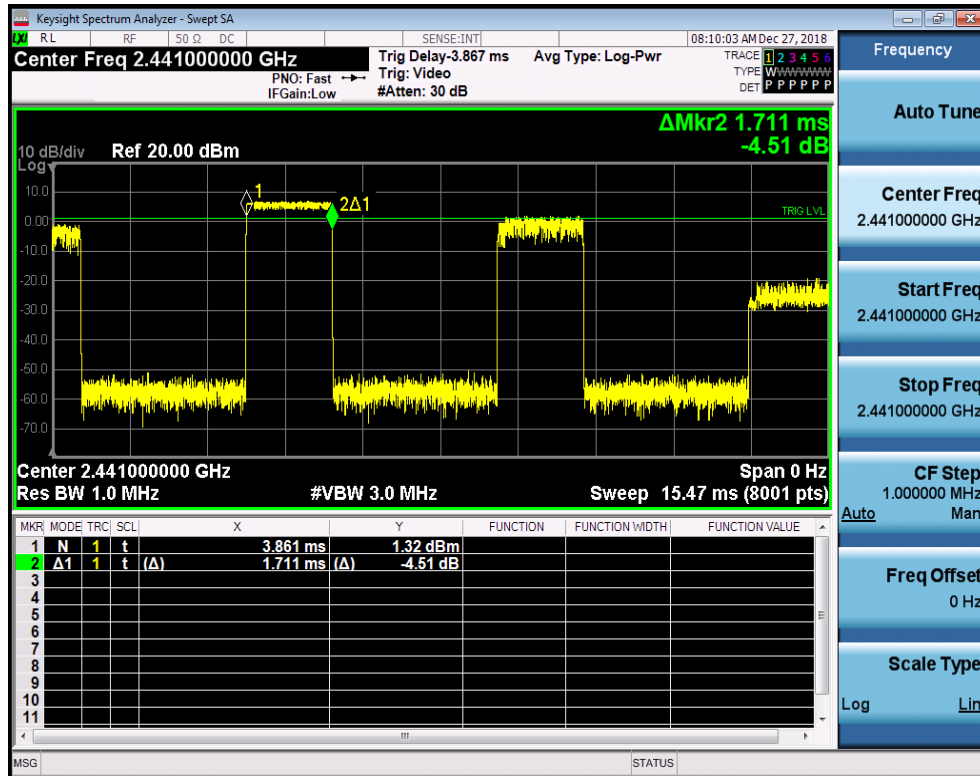





SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch


Report No.: GZEM181100248301
Page: 80 of 118


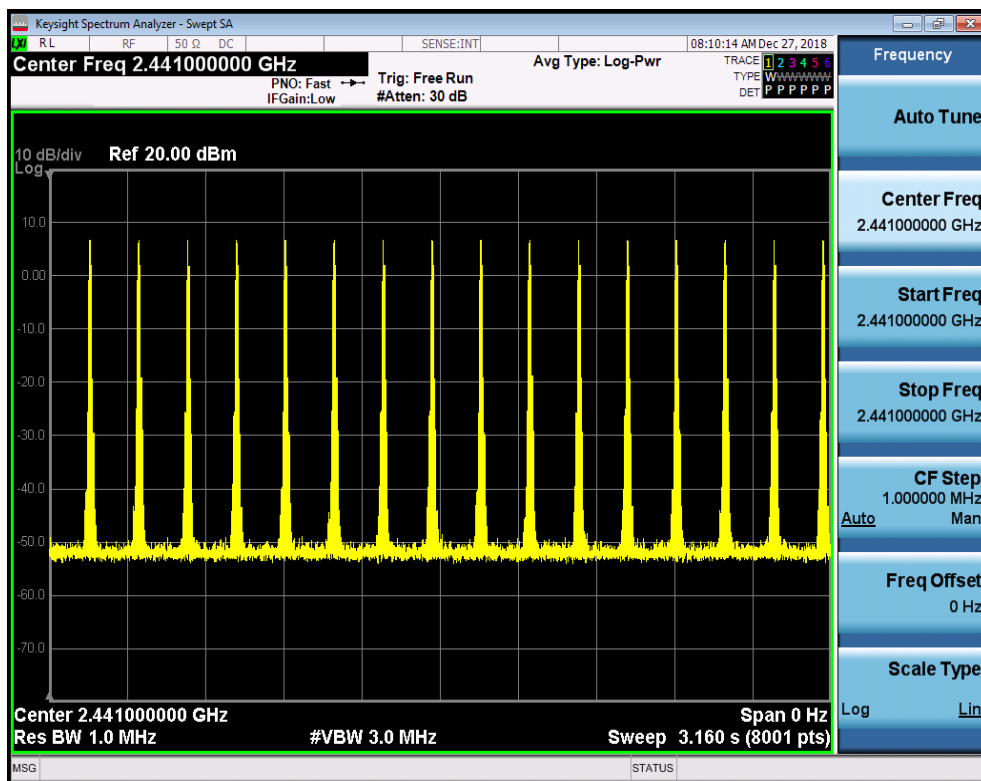


Dwell Time_2DH5_2480

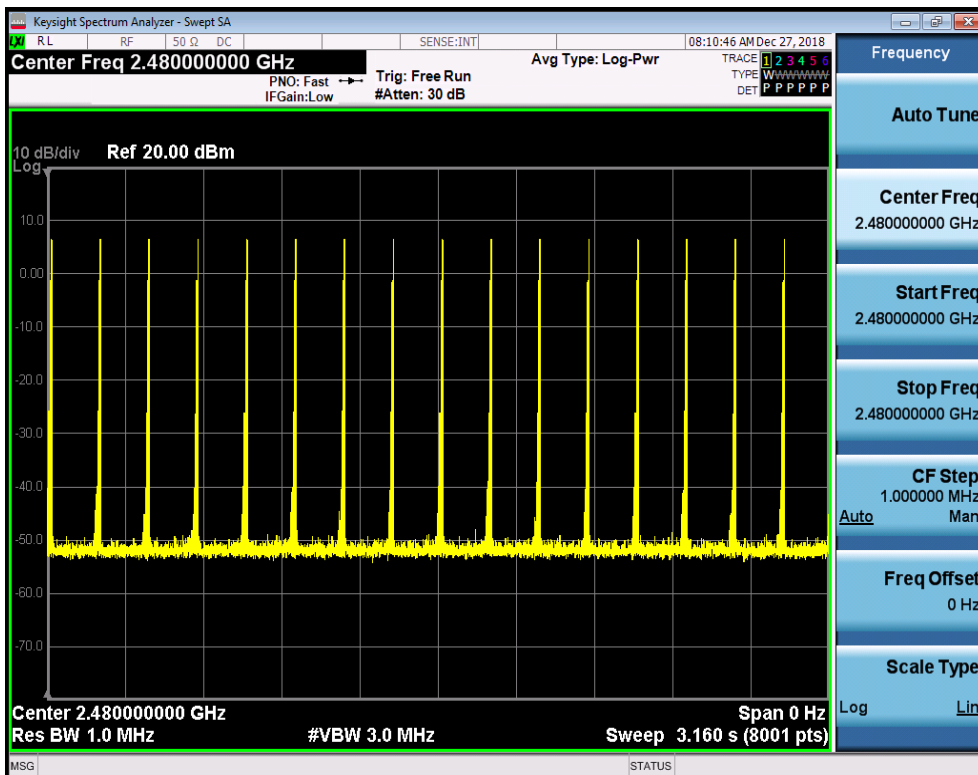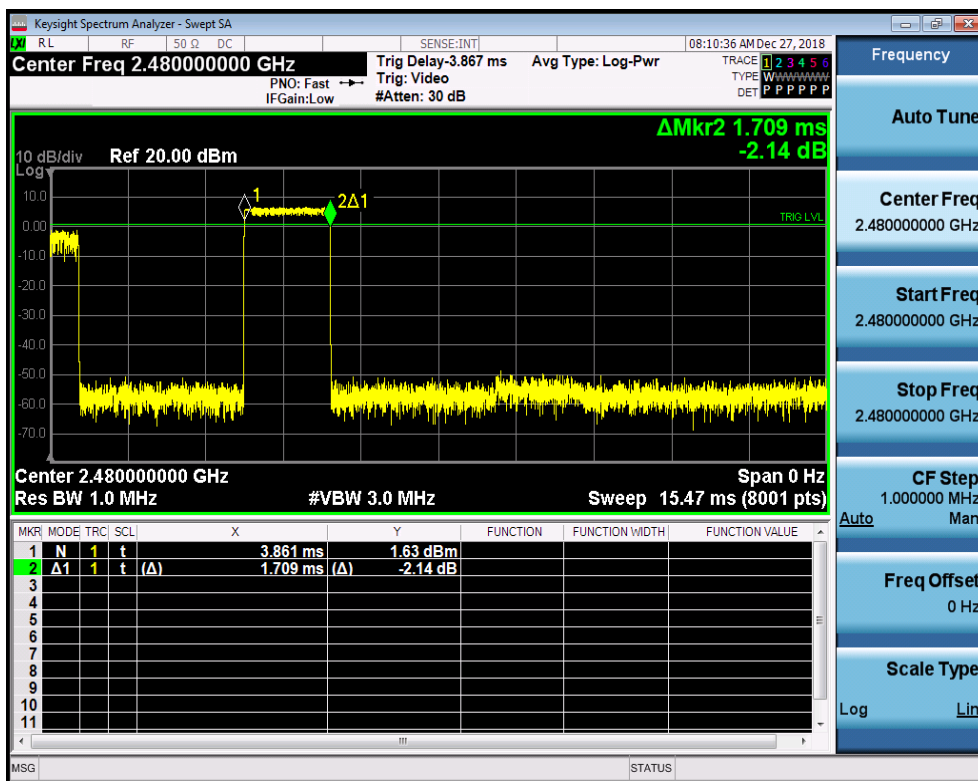

Dwell Time_3DH1_2402

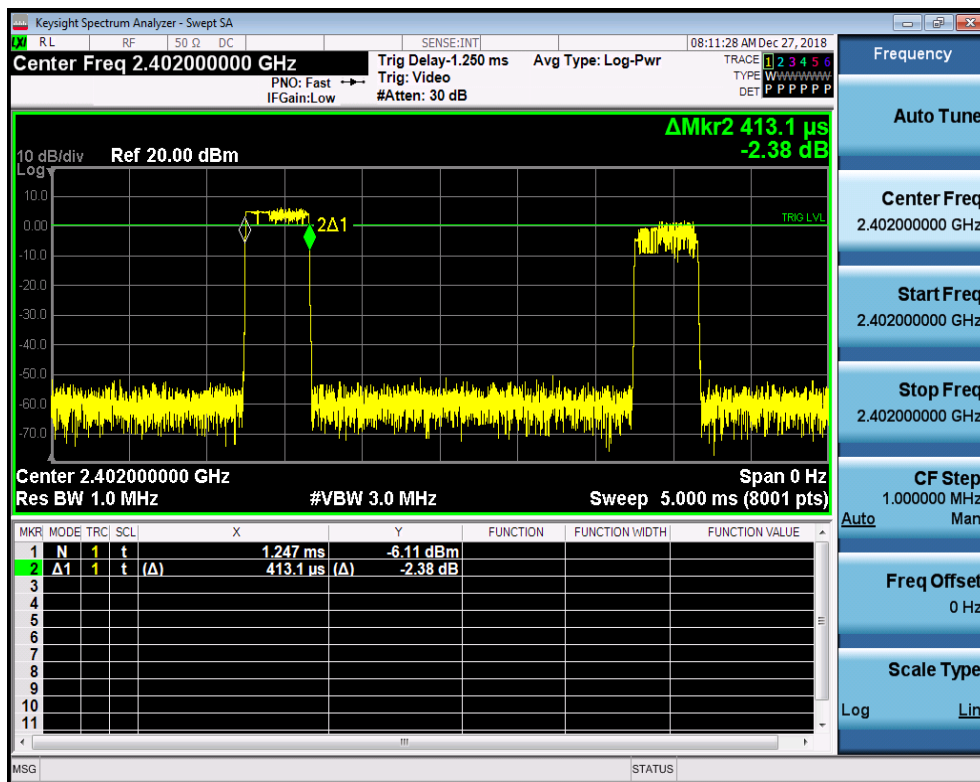

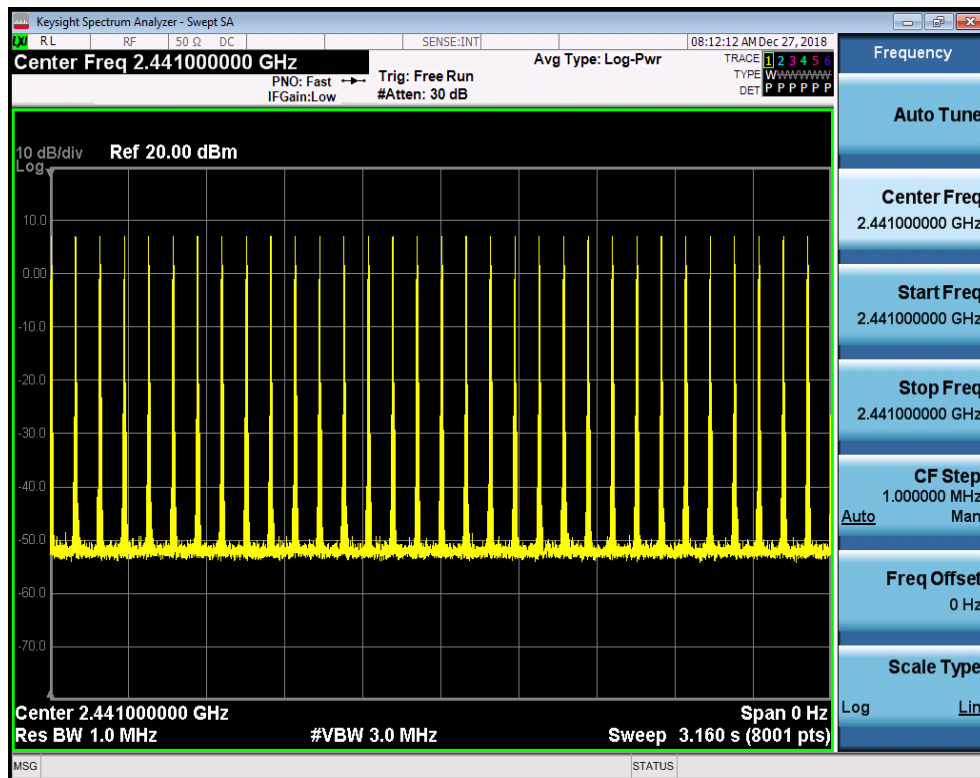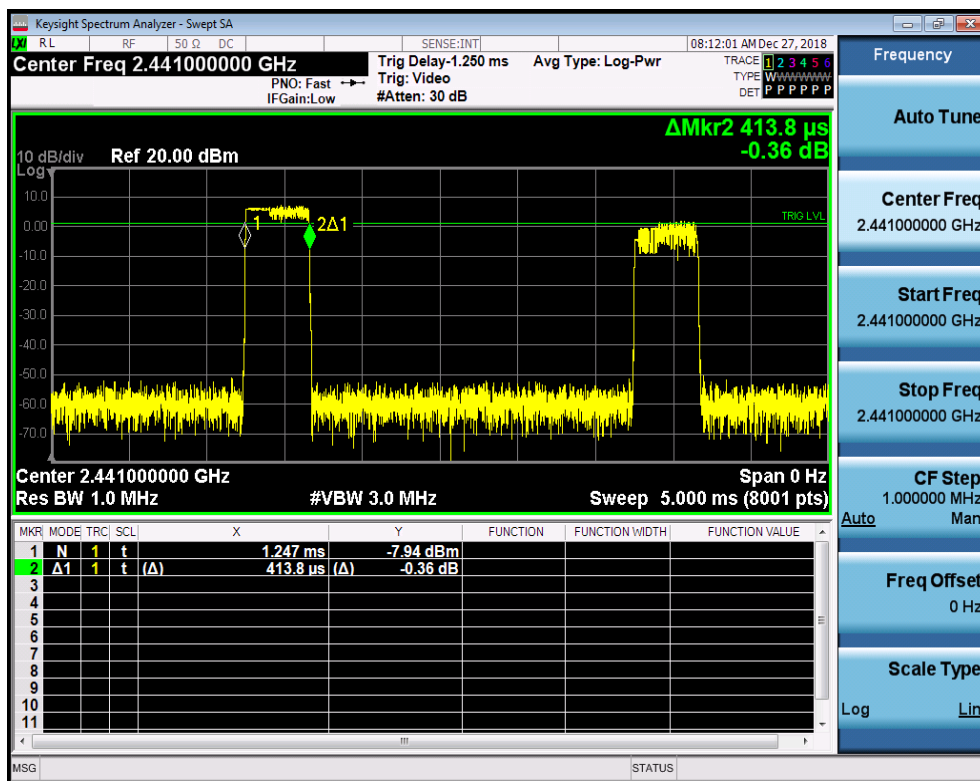





SGS-CSTC Standards Technical Services Co., Ltd. Guangzhou Branch



Report No.: GZEM181100248301
Page: 85 of 118

Dwell Time_3DH1_2480

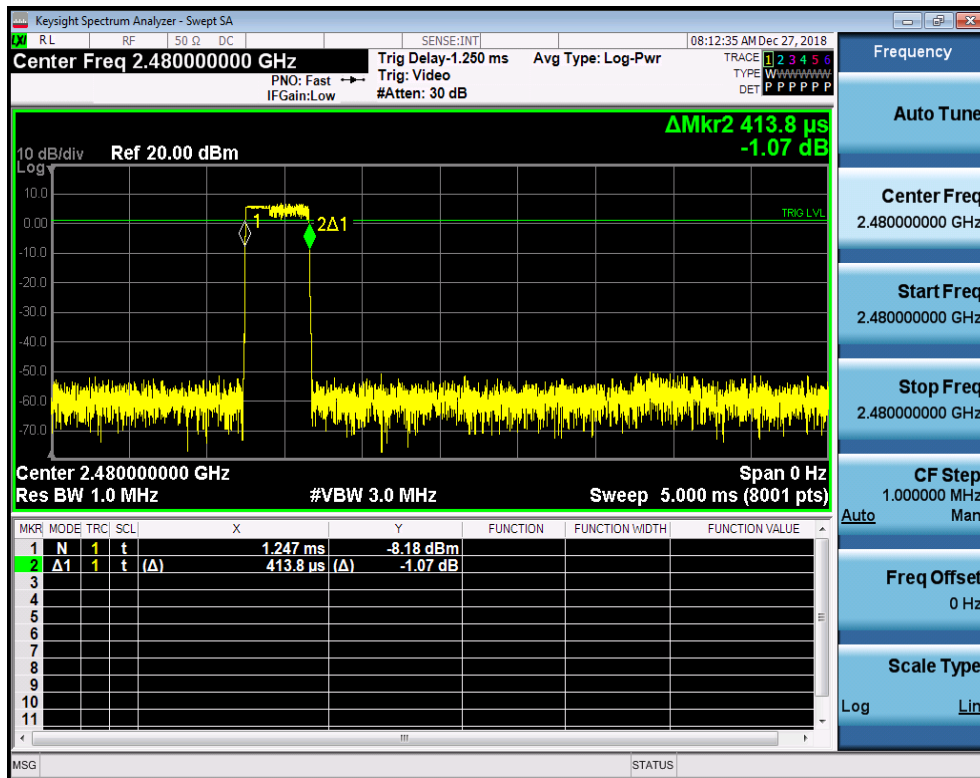


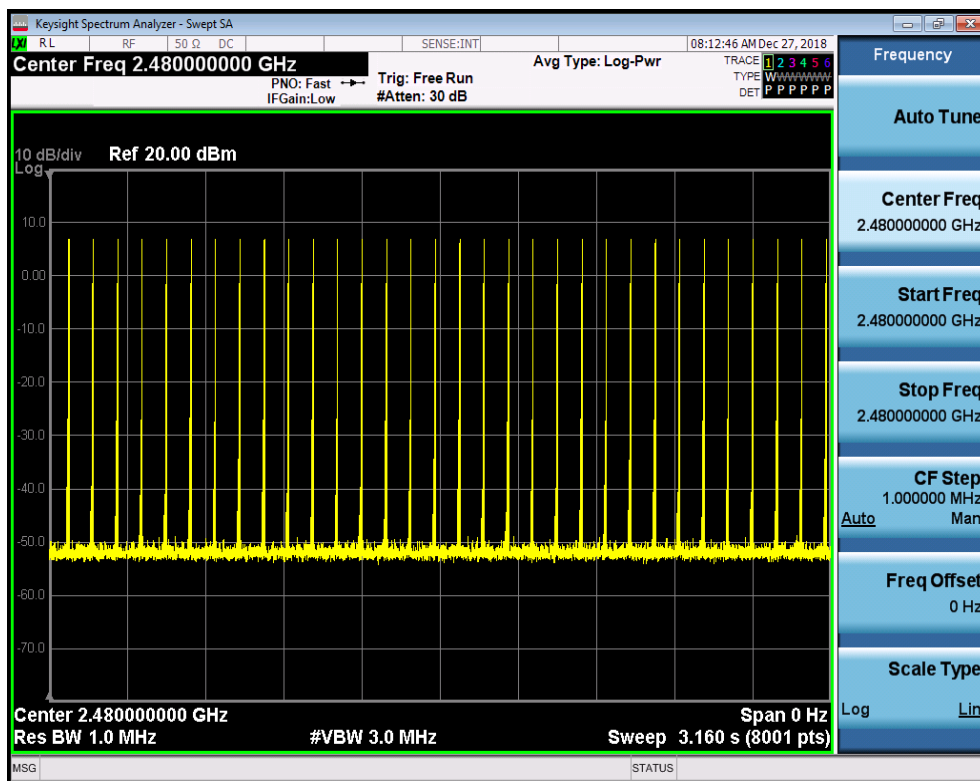

Dwell Time_3DH3_2402

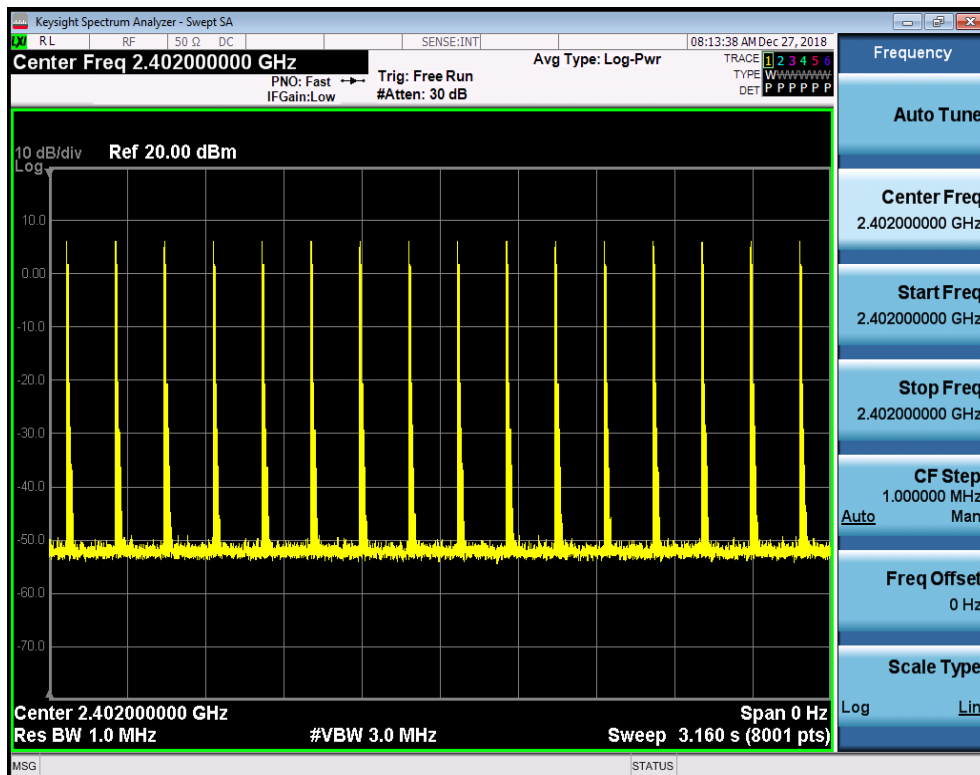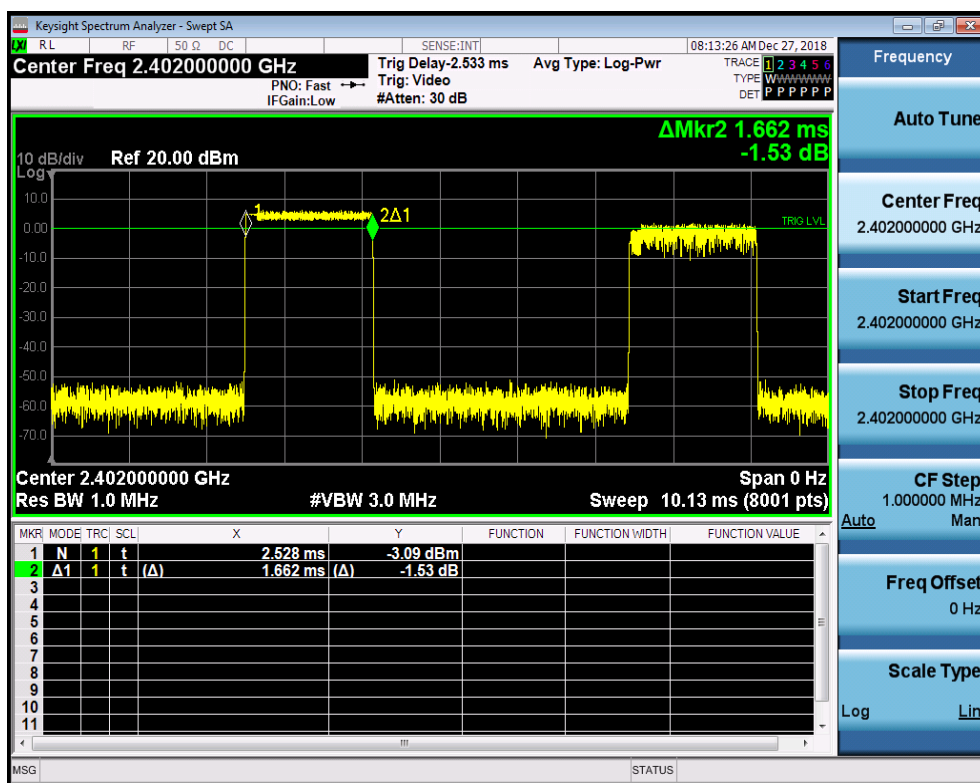


Dwell Time_3DH3_2441

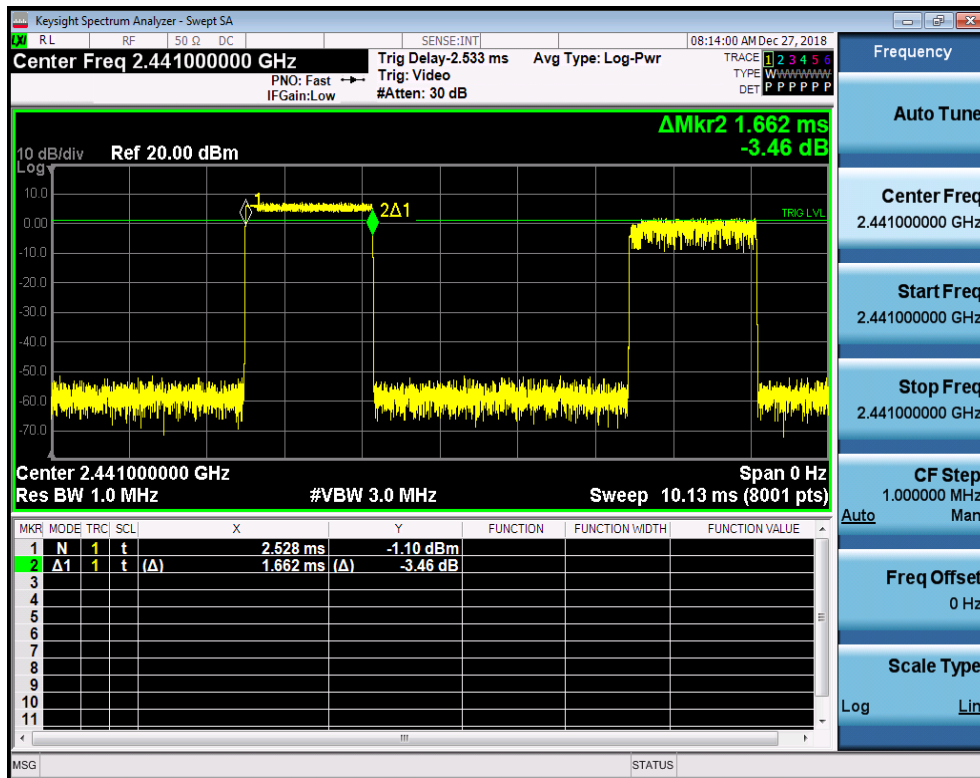





SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch

Report No.: GZEM181100248301
Page: 89 of 118

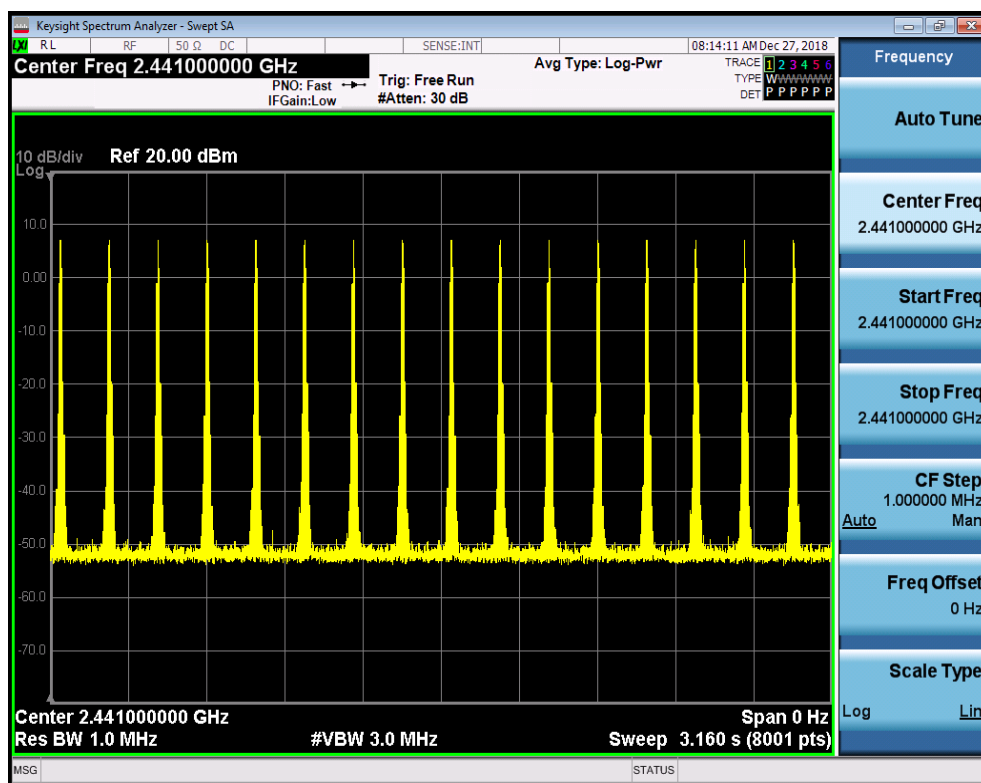

Dwell Time_3DH3_2480

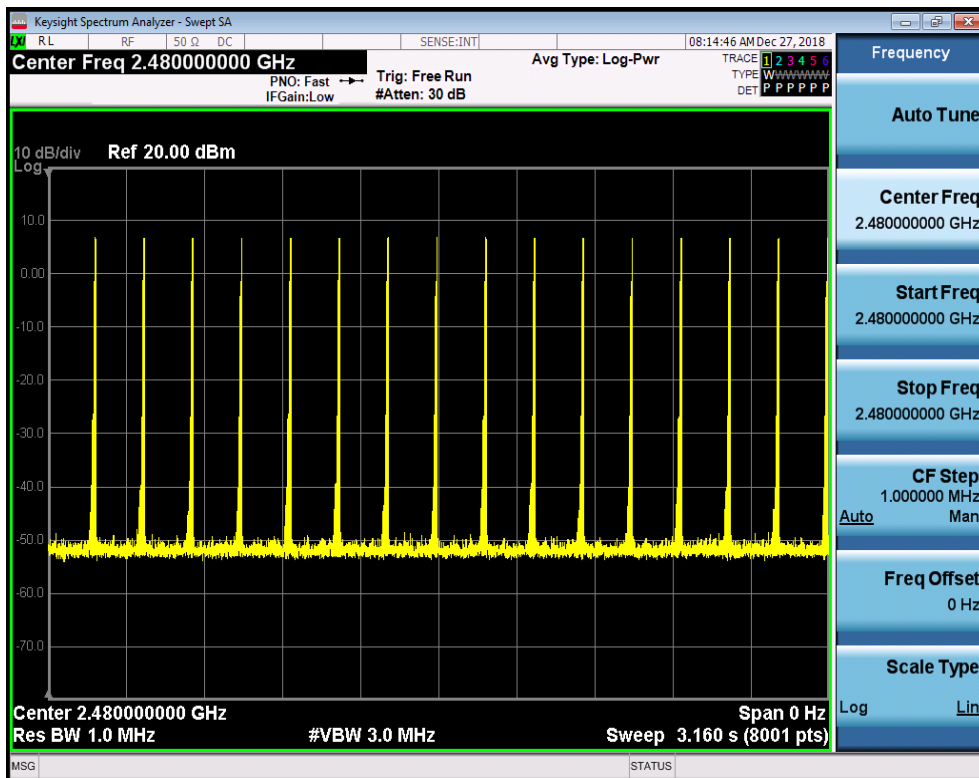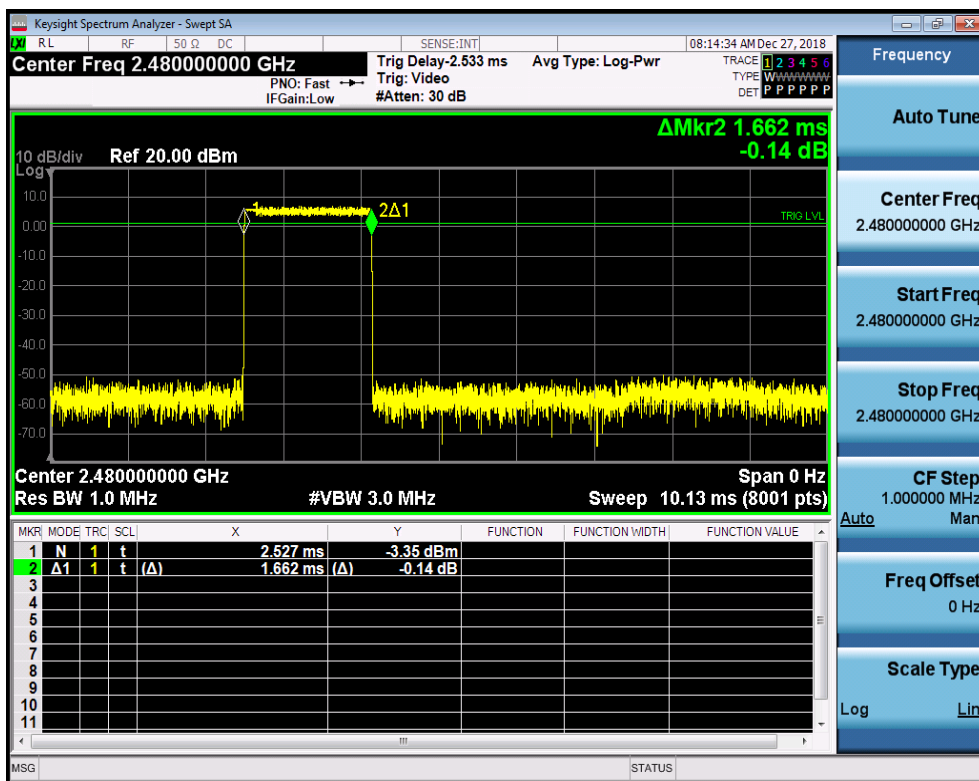





SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch

Report No.: GZEM181100248301
Page: 91 of 118

Dwell Time_3DH5_2402

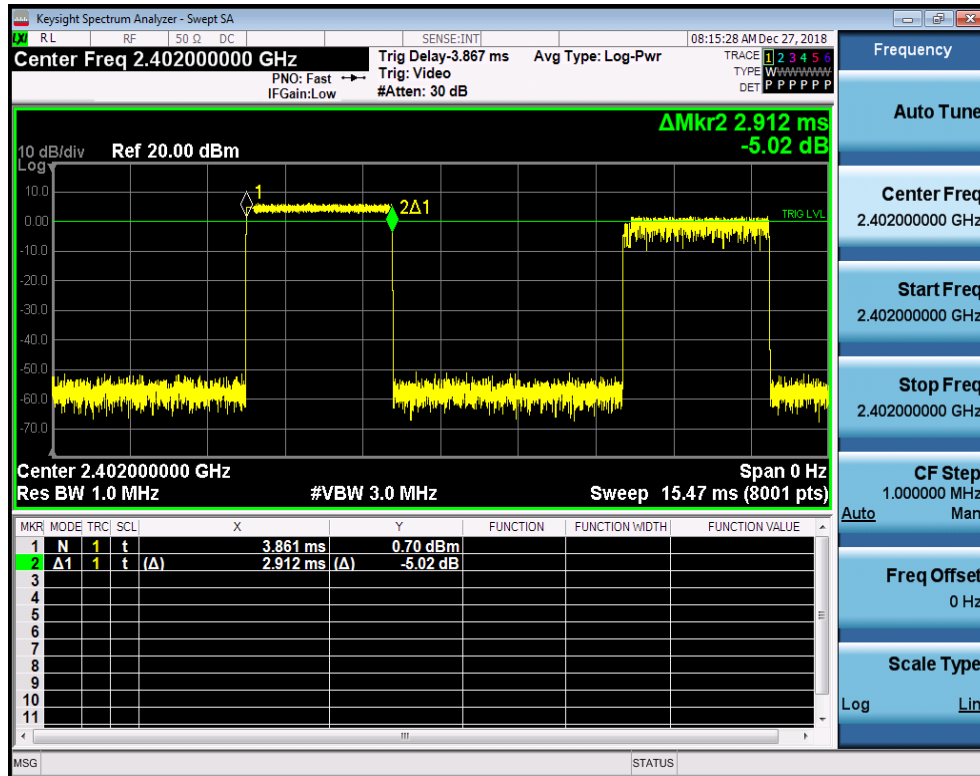


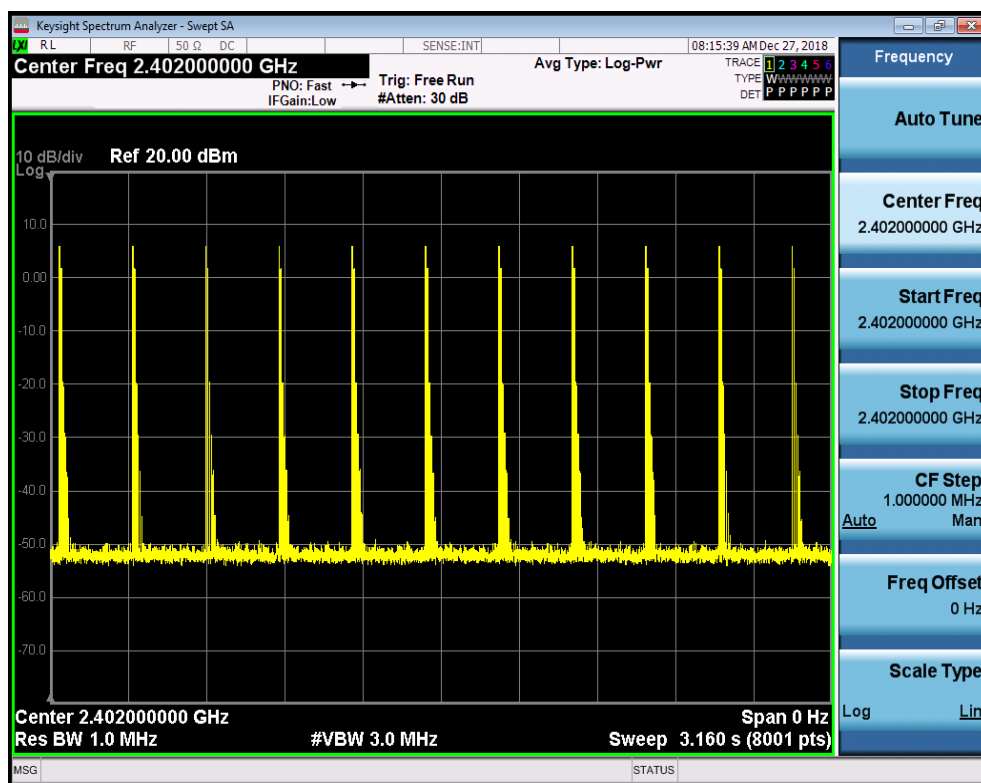


Dwell Time_3DH5_2441



SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch

Report No.: GZEM181100248301
Page: 93 of 118

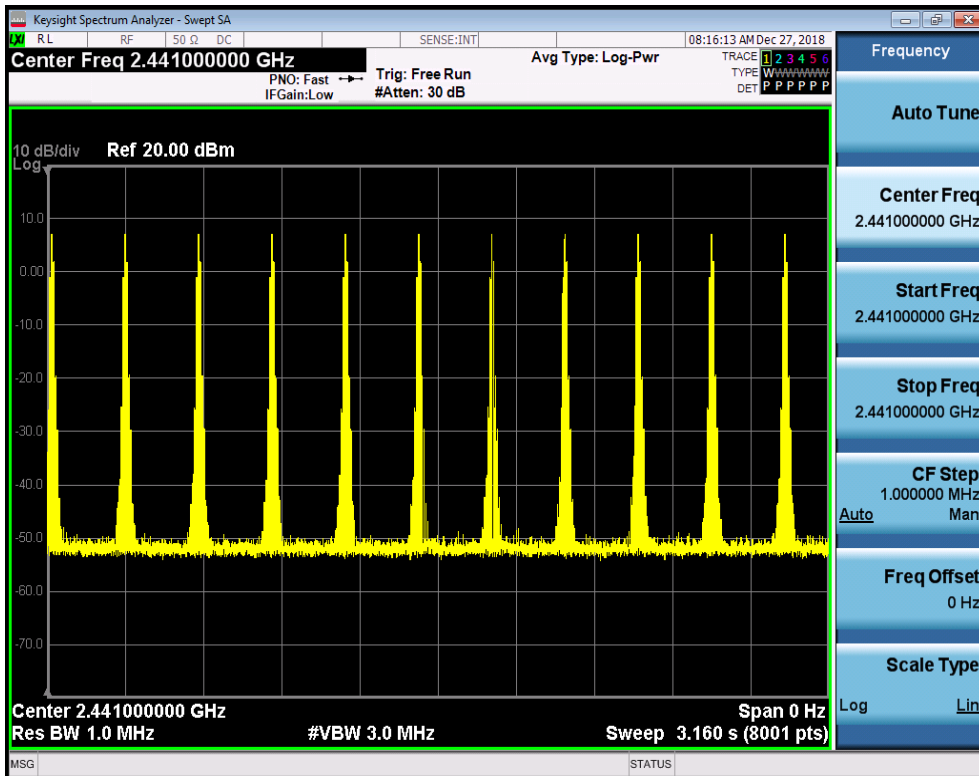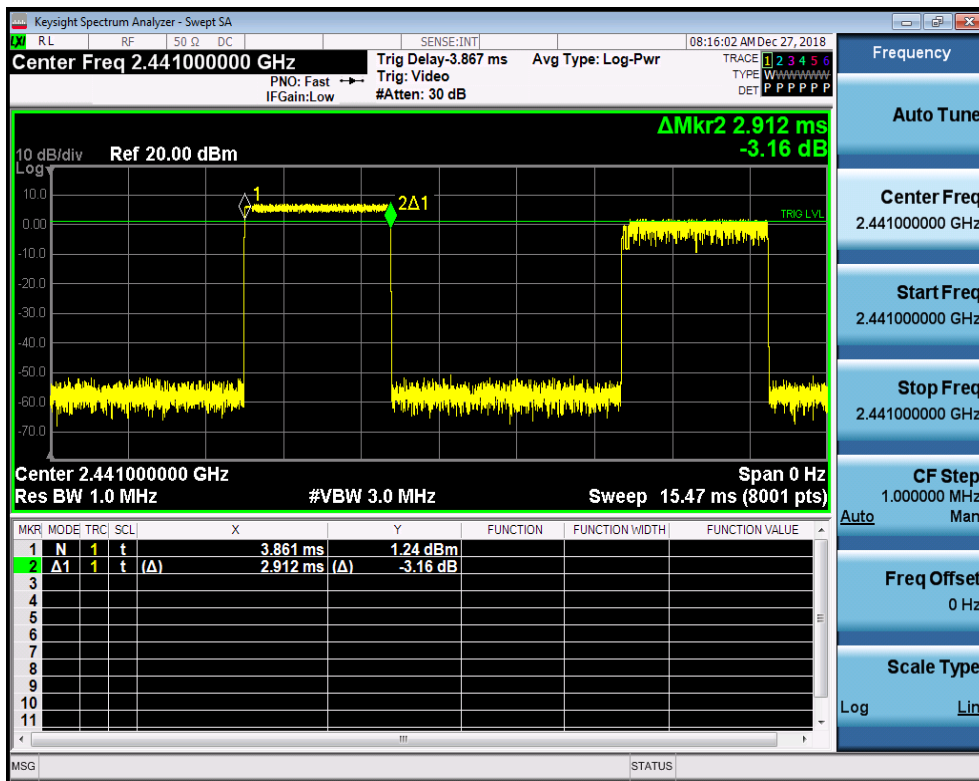





SGS-CSTC Standards Technical Services Co., Ltd. Guangzhou Branch

Report No.: GZEM181100248301
Page: 94 of 118

Dwell Time_3DH5_2480

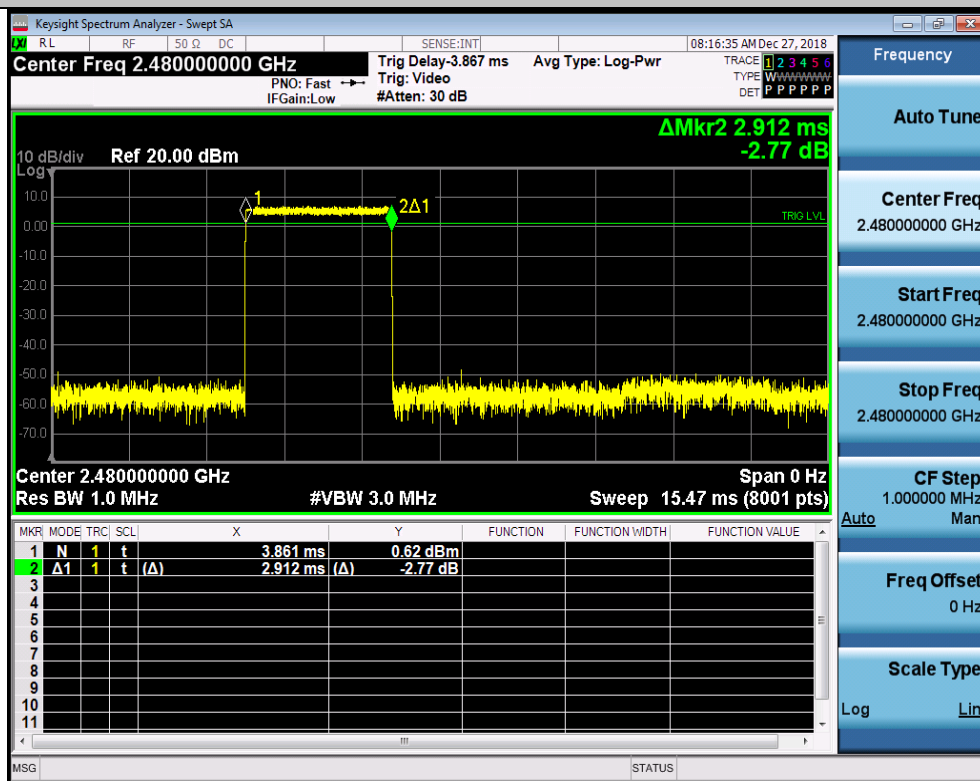

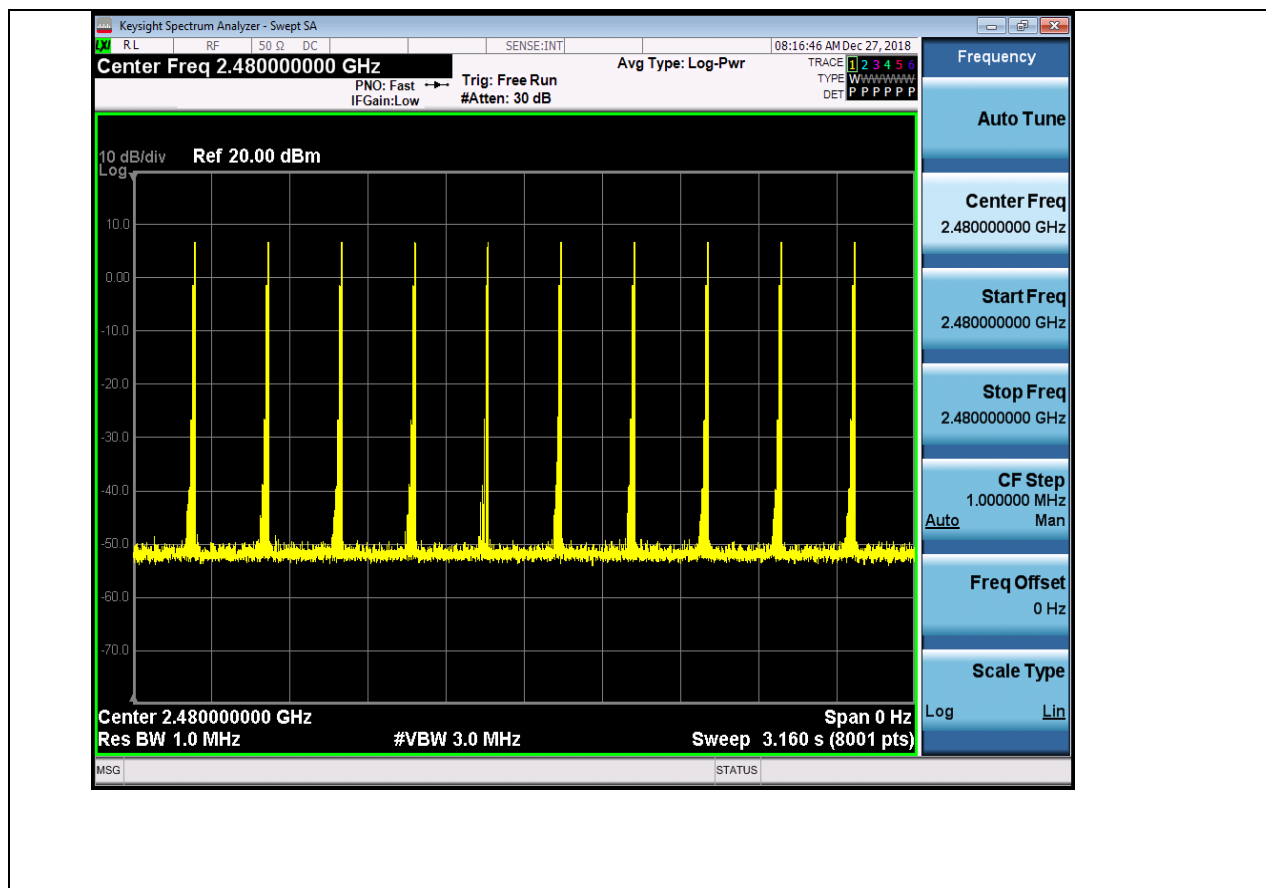


5.Hopping Channel Number


Test Mode	Test Channel	Number of Hopping Channel[N]	Limit[N]	Verdict
DH5	All channel hopping	79	≥ 15	PASS
2DH5	All channel hopping	79	≥ 15	PASS
3DH5	All channel hopping	79	≥ 15	PASS

TEST PLOT


Hopping Channel Number_DH5

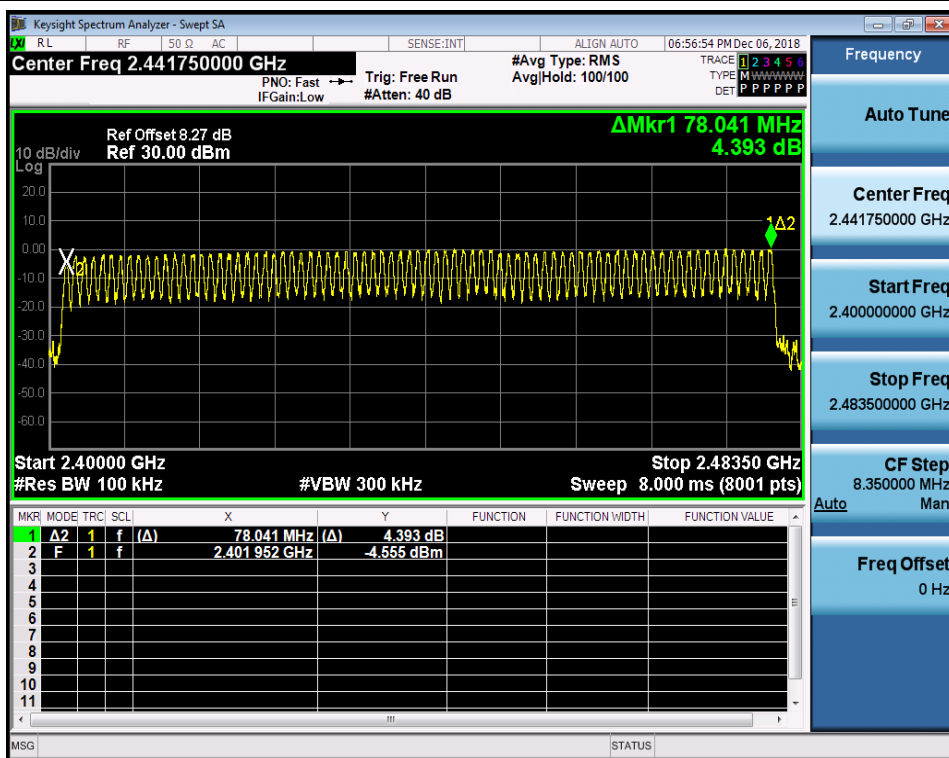

Hopping Channel Number_2DH5

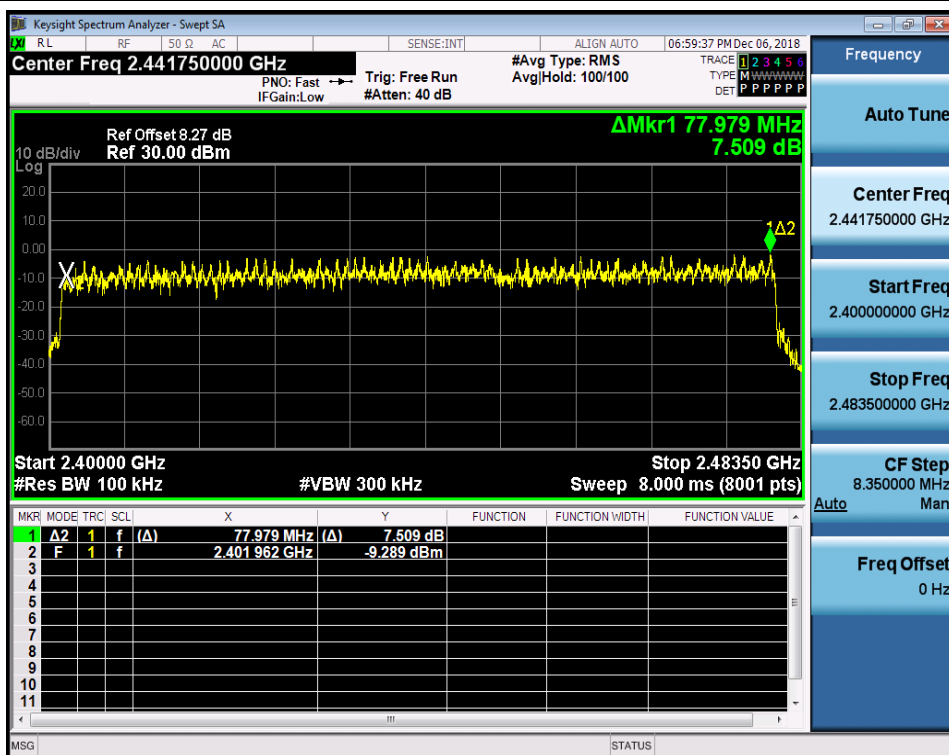

Hopping Channel Number_3DH5

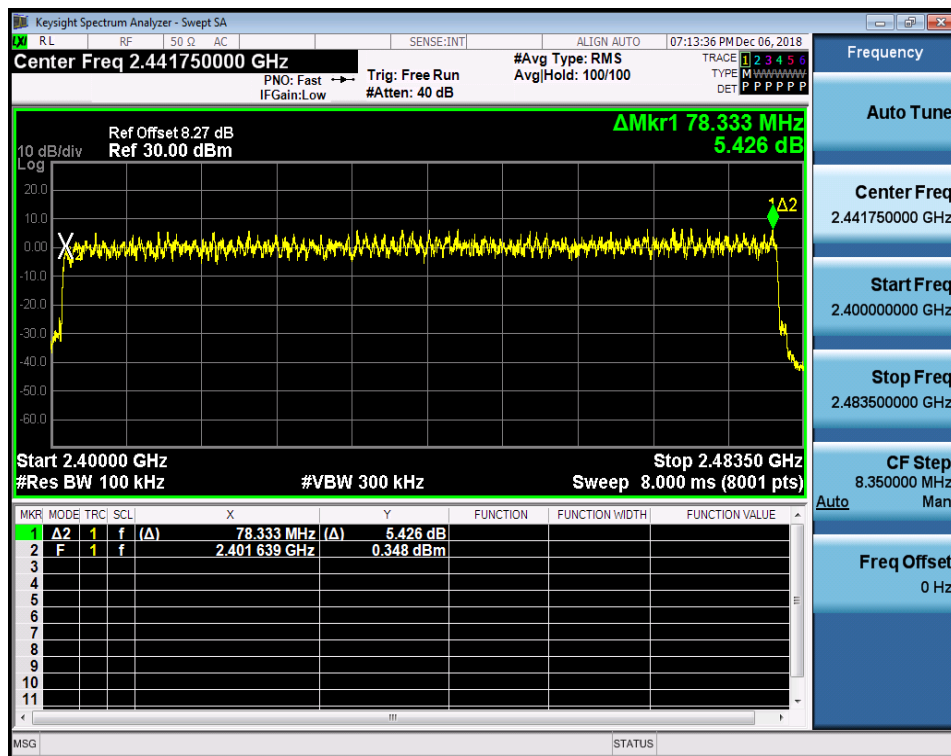


6. Band-edge for RF Conducted Emissions


Test Mode	Test Channel	Hopping	Carrier Power[dBm]	Max. Spurious Level [dBm]	Limit[dBm]	Verdict
DH5	2402	On	-0.829	-38.866	-20.83	PASS
DH5	2402	Off	-0.288	-39.367	-20.29	PASS
DH5	2480	On	0.343	-36.510	-19.66	PASS
DH5	2480	Off	0.326	-40.169	-19.67	PASS
2DH5	2402	On	-2.936	-39.478	-22.94	PASS
2DH5	2402	Off	-1.042	-40.100	-21.04	PASS
2DH5	2480	On	-1.588	-39.187	-21.59	PASS
2DH5	2480	Off	-2.599	-39.739	-22.6	PASS
3DH5	2402	On	5.406	-39.423	-14.59	PASS
3DH5	2402	Off	-1.084	-39.774	-21.08	PASS
3DH5	2480	On	6.718	-39.353	-13.28	PASS
3DH5	2480	Off	-1.473	-39.686	-21.47	PASS

TEST PLOT


Band-edge for RF Conducted Emissions_DH5_2402_Hopping On

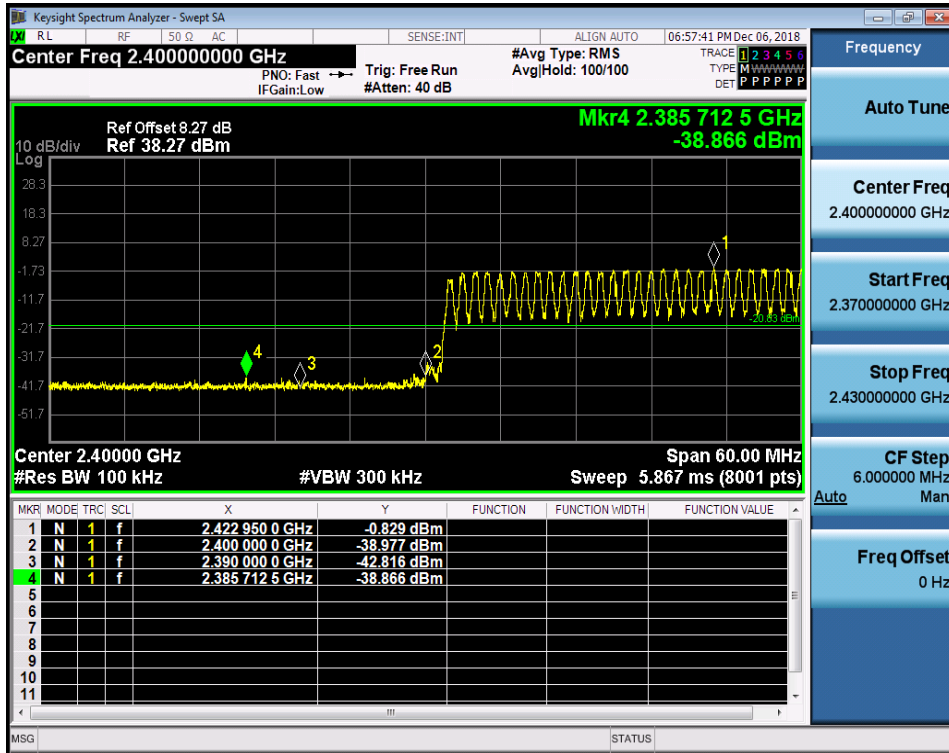


Band-edge for RF Conducted Emissions_DH5_2402_Hopping Off

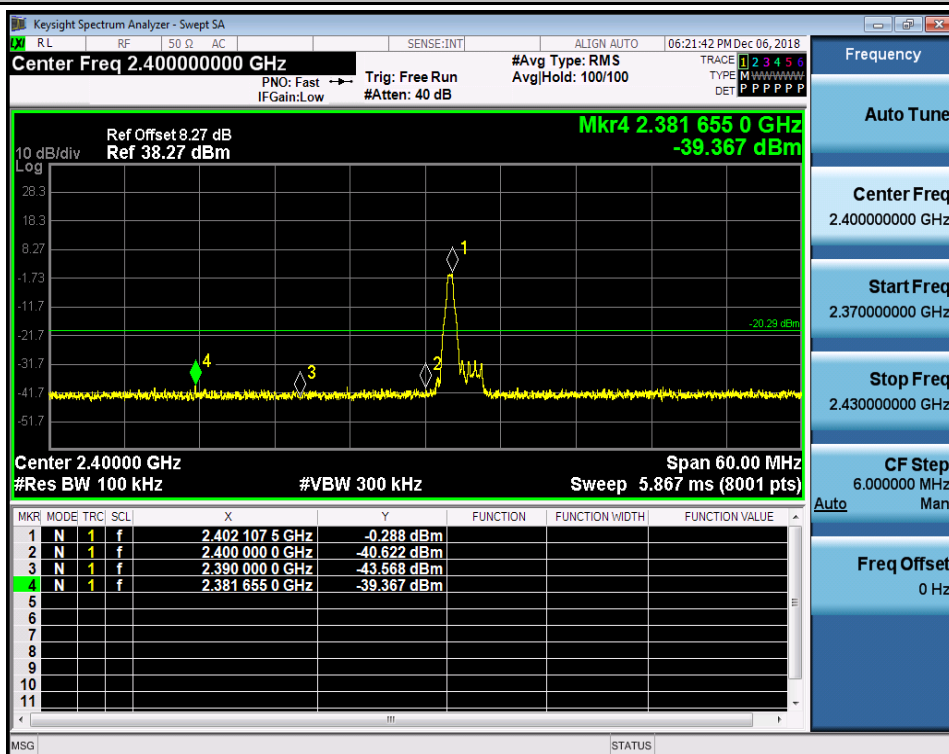


Band-edge for RF Conducted Emissions_DH5_2480_Hopping On

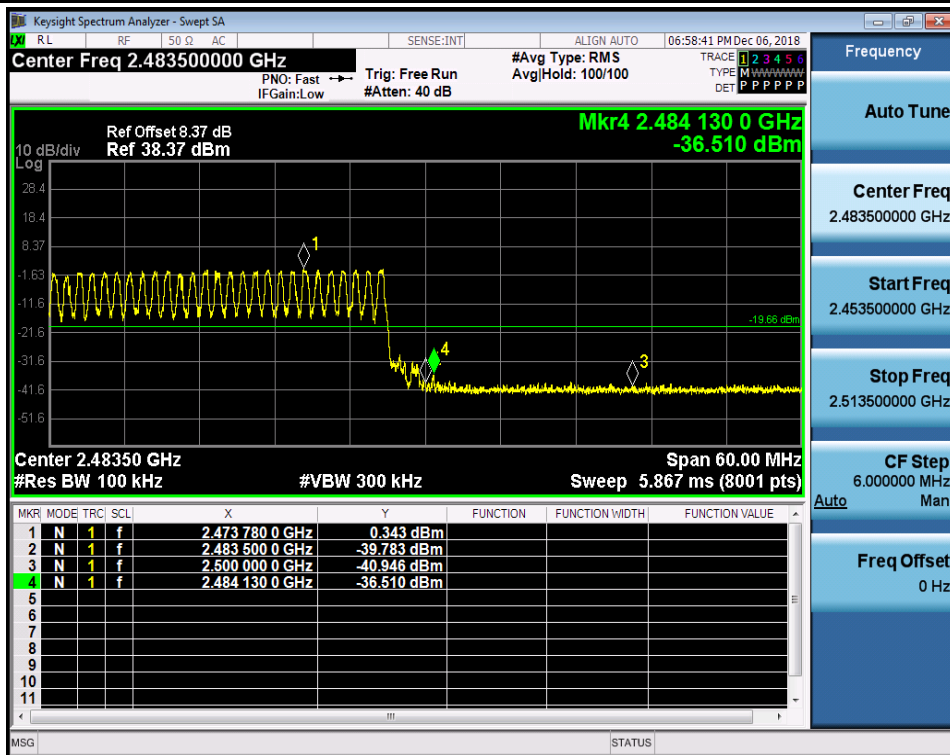


Band-edge for RF Conducted Emissions_DH5_2480_Hopping Off

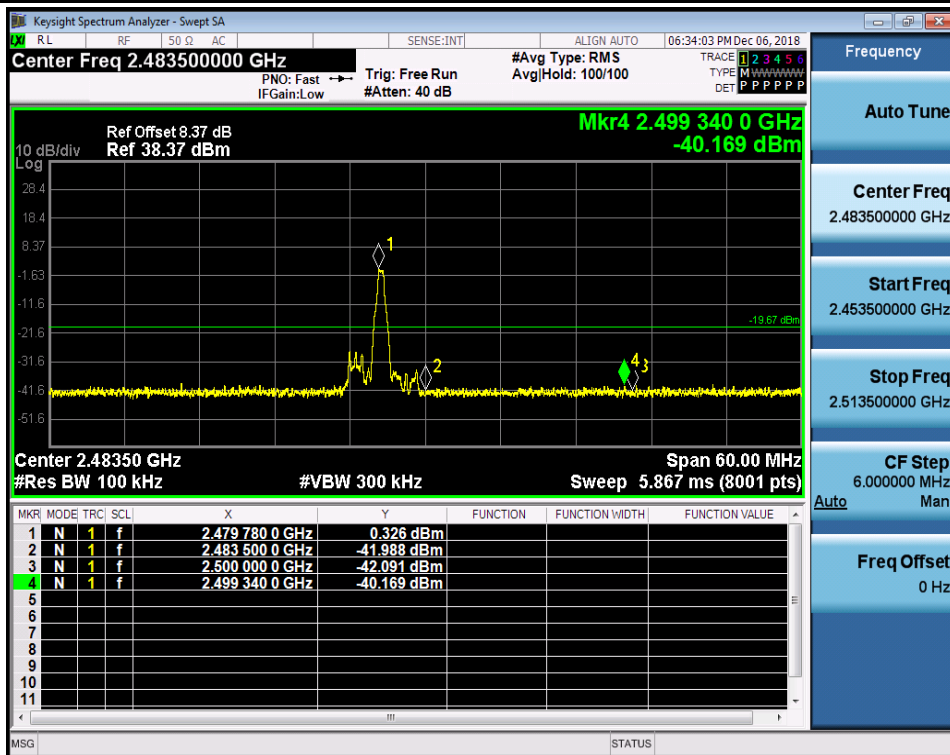


Band-edge for RF Conducted Emissions_2DH5_2402_Hopping On

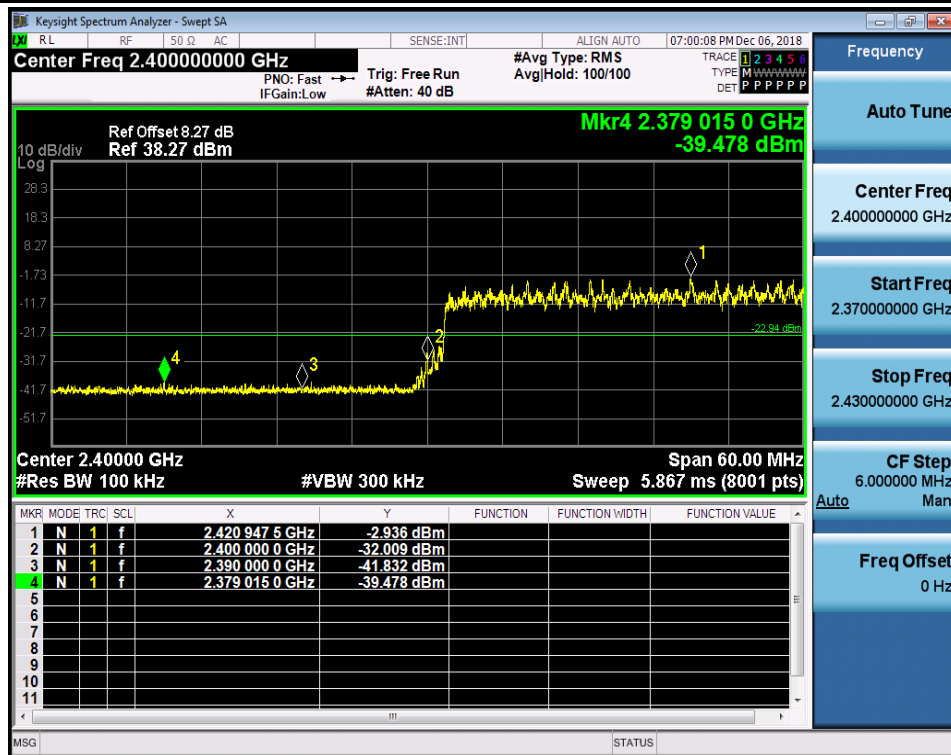


Band-edge for RF Conducted Emissions_2DH5_2402_Hopping Off

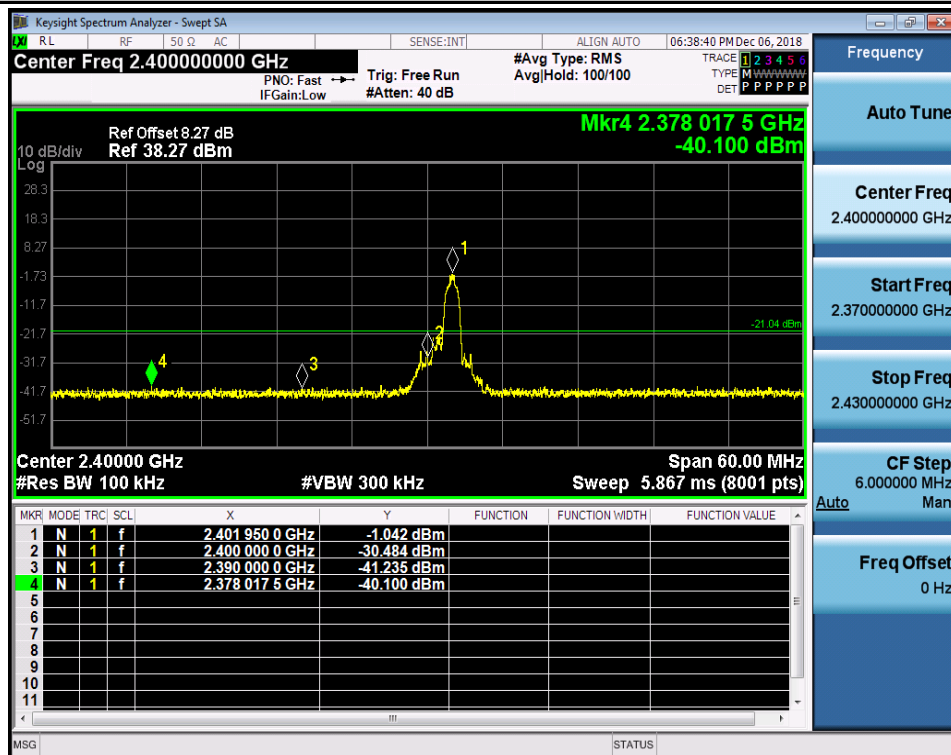


Band-edge for RF Conducted Emissions_2DH5_2480_Hopping On

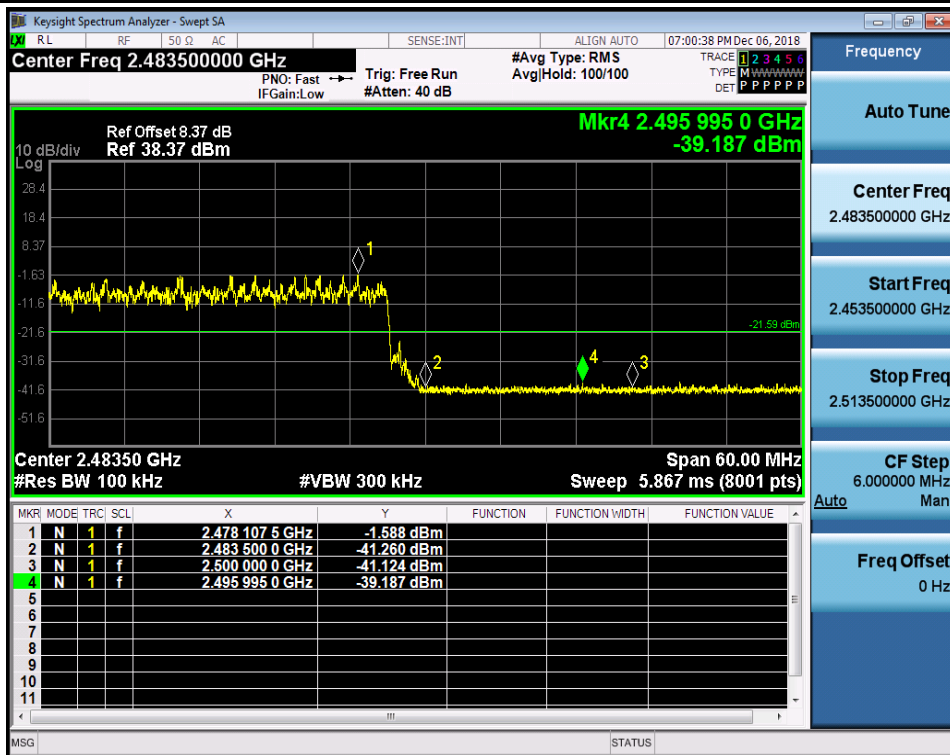


Band-edge for RF Conducted Emissions_2DH5_2480_Hopping Off

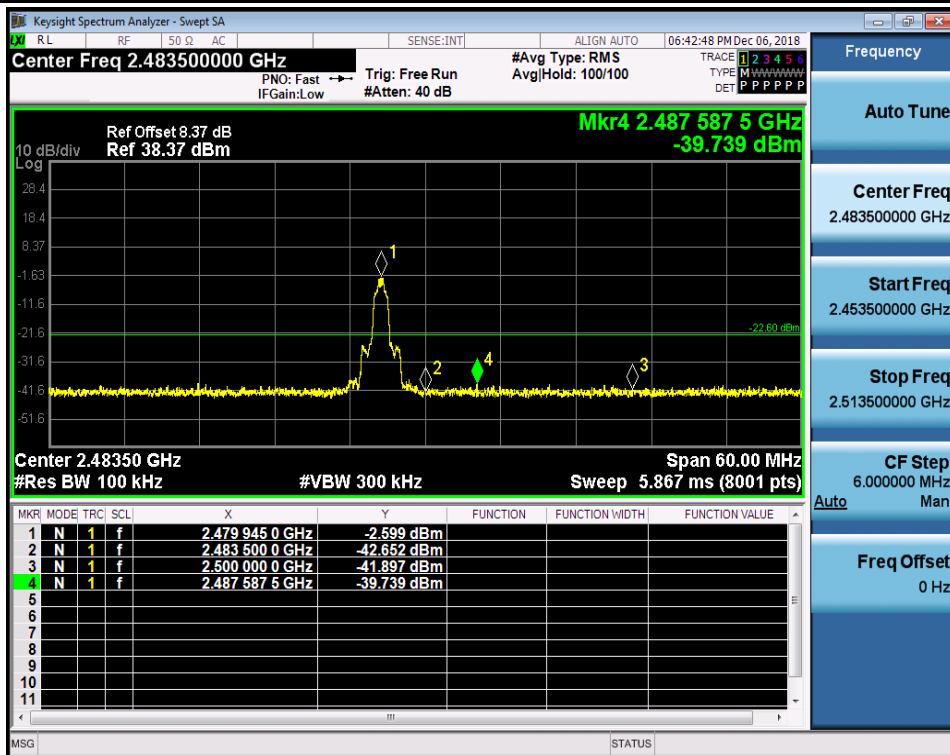


Band-edge for RF Conducted Emissions_3DH5_2402_Hopping On

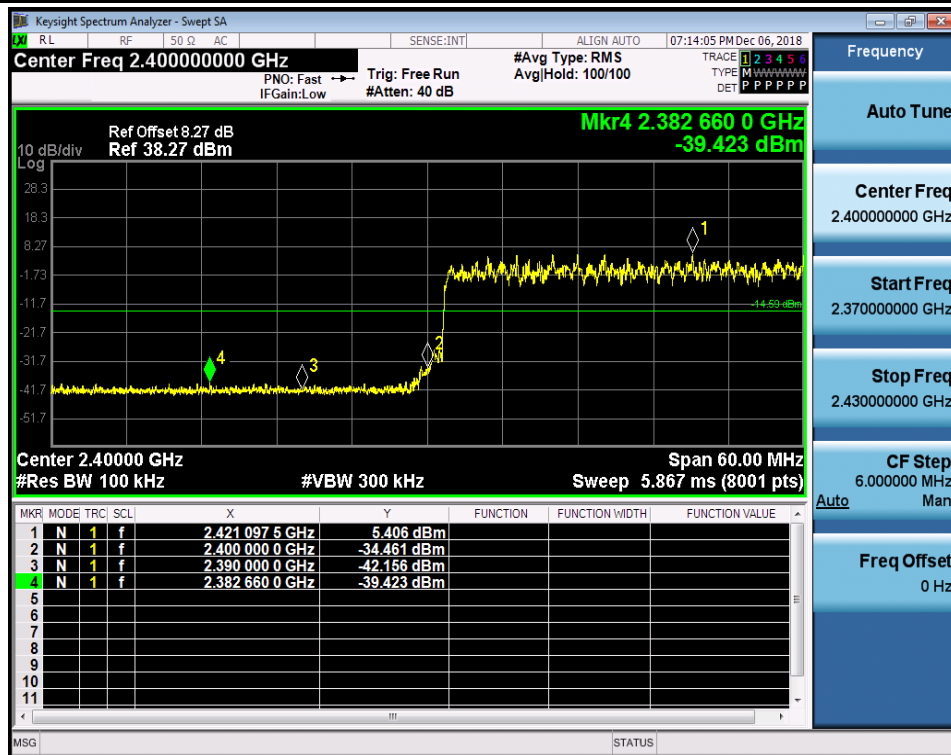


Band-edge for RF Conducted Emissions_3DH5_2402_Hopping Off

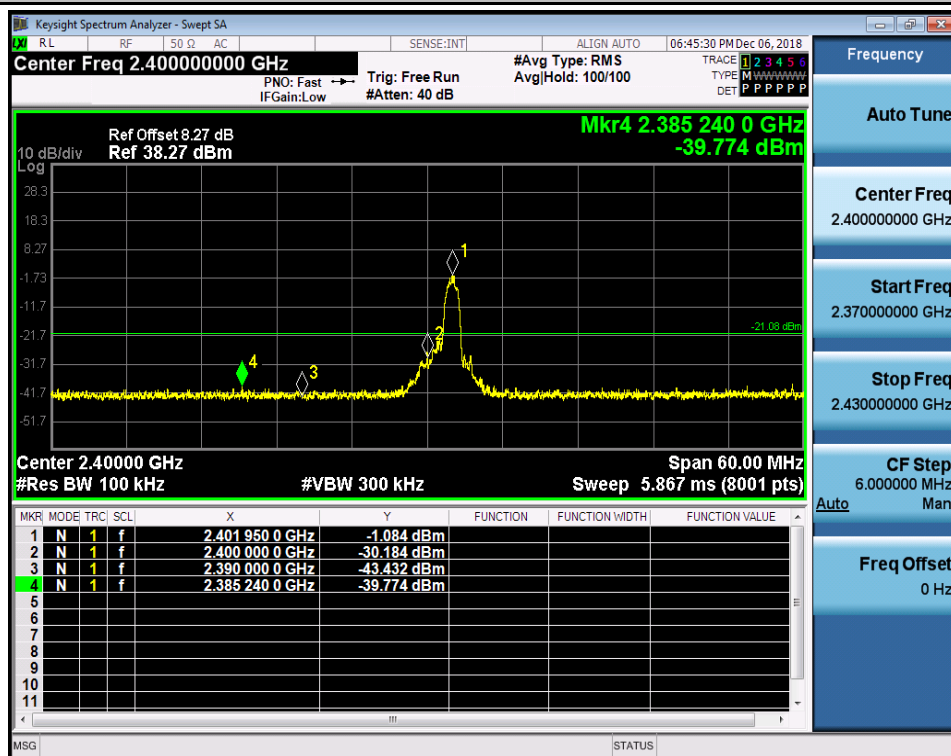

Band-edge for RF Conducted Emissions_3DH5_2480_Hopping On

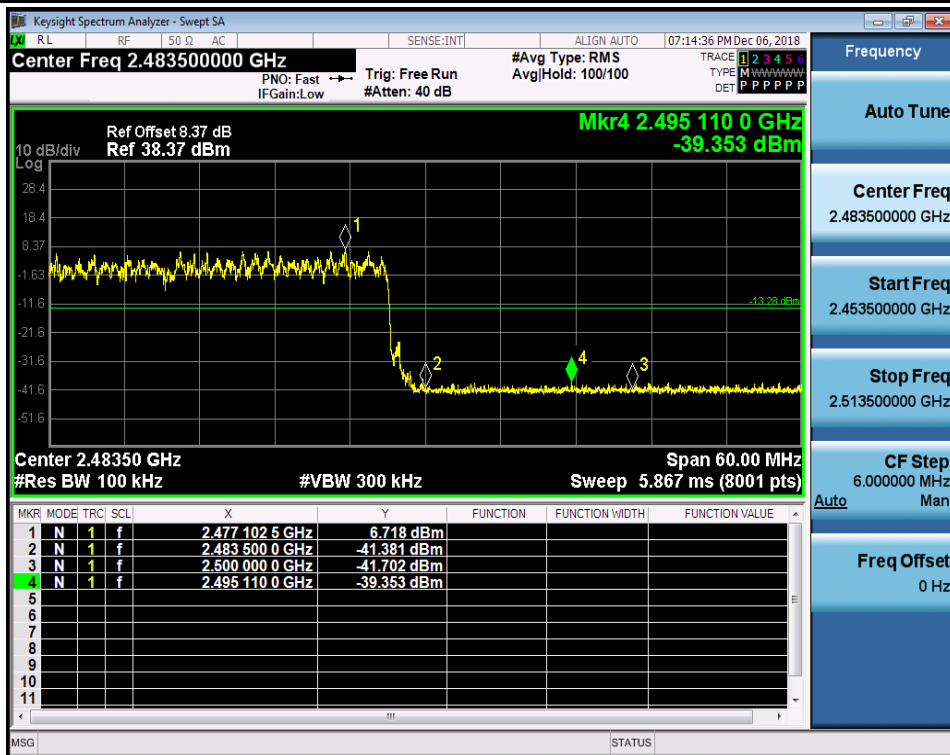

Band-edge for RF Conducted Emissions_3DH5_2480_Hopping Off

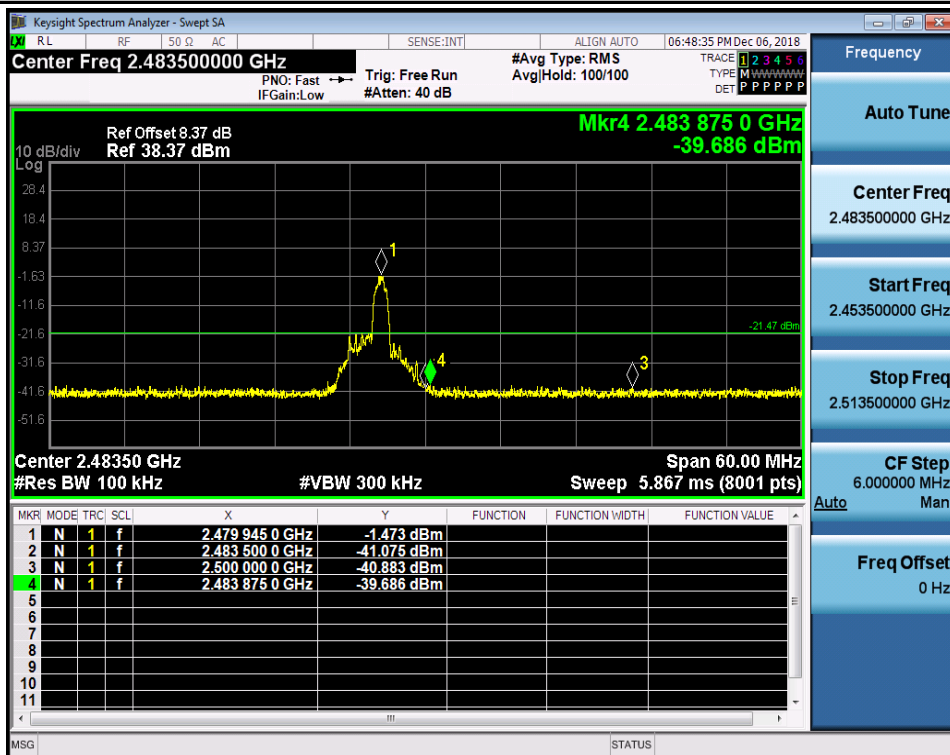




SGS-CSTC Standards Technical Services Co., Ltd. Guangzhou Branch


Report No.: GZEM181100248301
Page: 104 of 118

7.RF Conducted Spurious Emissions

Test Mode	Test Channel	StartFre [MHz]	StopFre [MHz]	RBW [kHz]	VBW [kHz]	Pref[dBm]	Max. Level [dBm]	Limit [dBm]	Verdict
DH5	2402	30	10000	100	300	0.413	-46.503	<-19.587	PASS
DH5	2402	10000	26000	100	300	0.413	-45.022	<-19.587	PASS
DH5	2441	30	10000	100	300	0.34	-47.144	<-19.66	PASS
DH5	2441	10000	26000	100	300	0.34	-44.349	<-19.66	PASS
DH5	2480	30	10000	100	300	0.102	-46.815	<-19.898	PASS
DH5	2480	10000	26000	100	300	0.102	-44.036	<-19.898	PASS
2DH5	2402	30	10000	100	300	0.17	-47.664	<-19.83	PASS
2DH5	2402	10000	26000	100	300	0.17	-44.788	<-19.83	PASS
2DH5	2441	30	10000	100	300	0.38	-46.799	<-19.62	PASS
2DH5	2441	10000	26000	100	300	0.38	-43.886	<-19.62	PASS
2DH5	2480	30	10000	100	300	0.332	-46.808	<-19.668	PASS
2DH5	2480	10000	26000	100	300	0.332	-44.197	<-19.668	PASS
3DH5	2402	30	10000	100	300	0.116	-46.914	<-19.884	PASS
3DH5	2402	10000	26000	100	300	0.116	-44.021	<-19.884	PASS
3DH5	2441	30	10000	100	300	0.616	-47.543	<-19.384	PASS
3DH5	2441	10000	26000	100	300	0.616	-43.725	<-19.384	PASS
3DH5	2480	30	10000	100	300	0.437	-47.134	<-19.563	PASS
3DH5	2480	10000	26000	100	300	0.437	-44.499	<-19.563	PASS

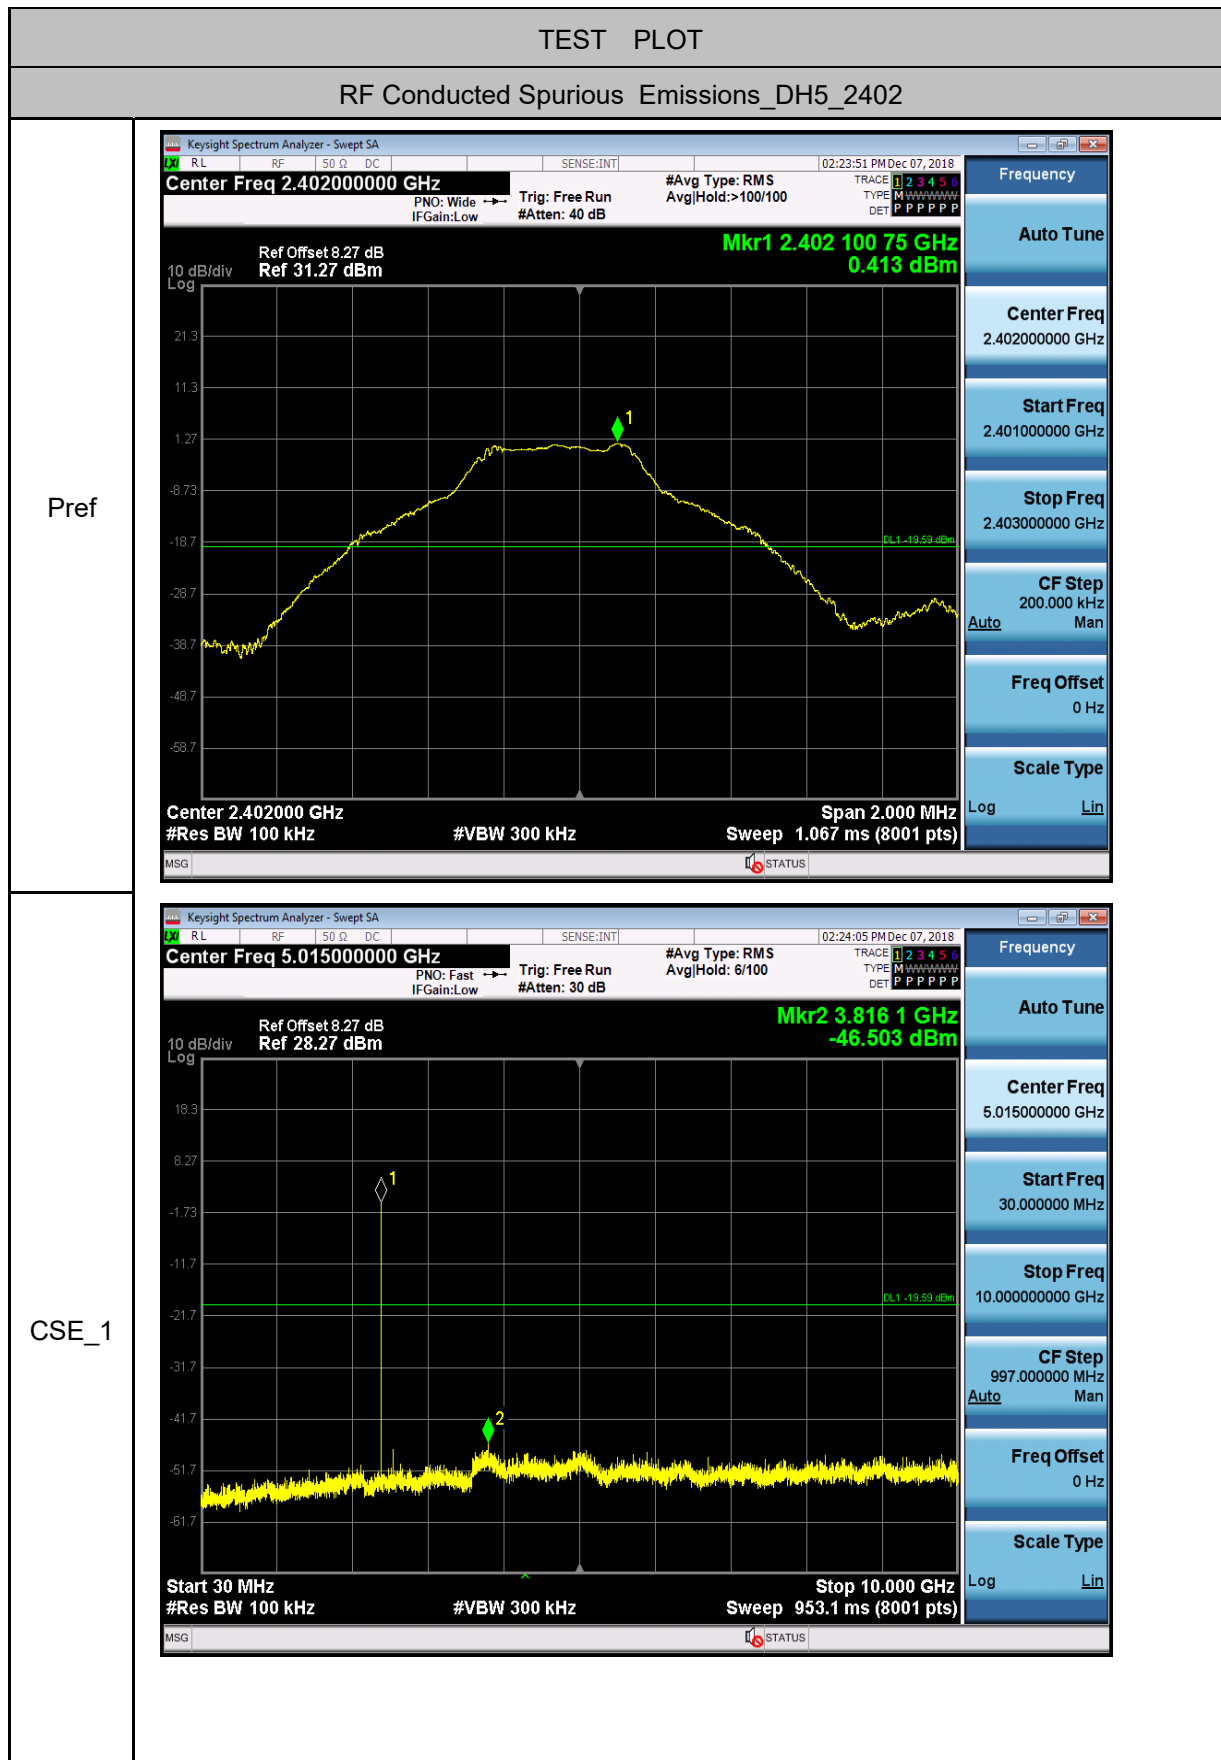

CSE_2

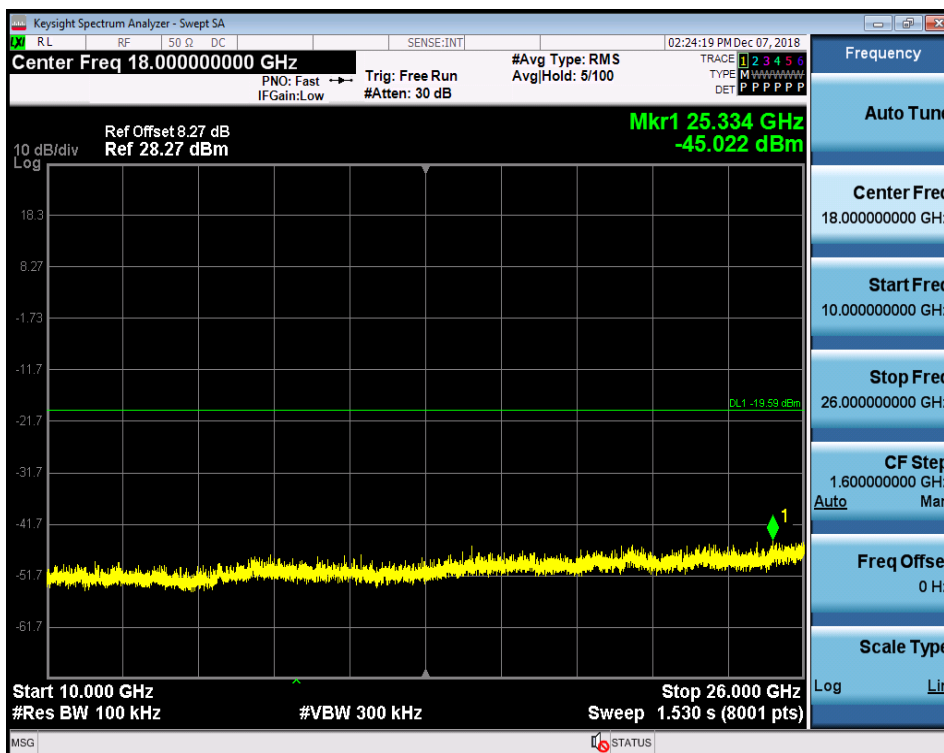


RF Conducted Spurious Emissions_DH5_2441


Pref



CSE_1

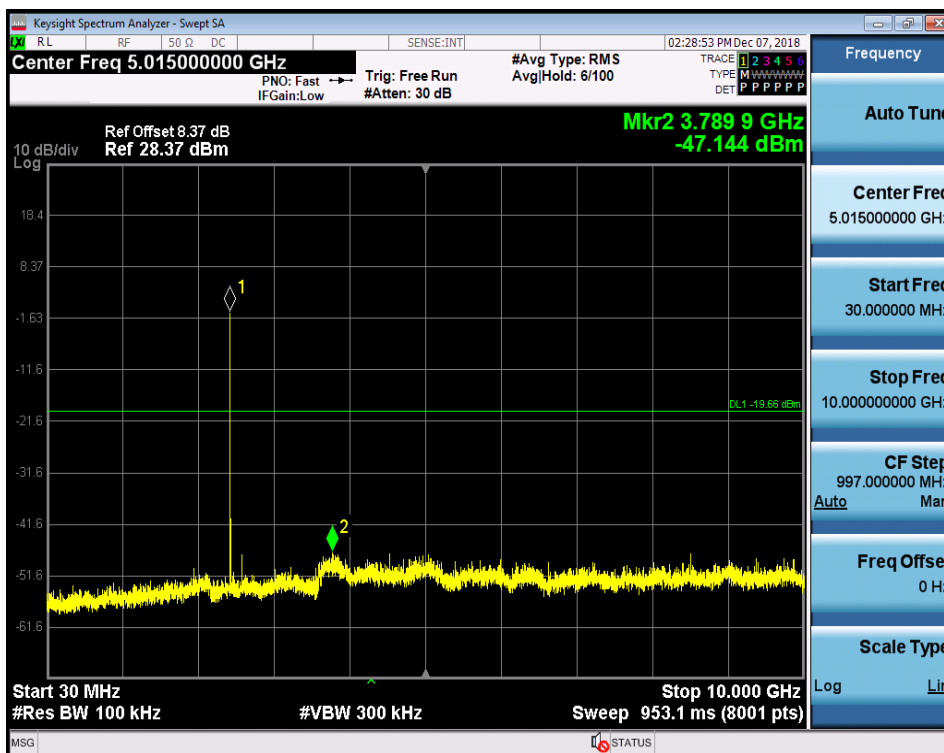

CSE_2

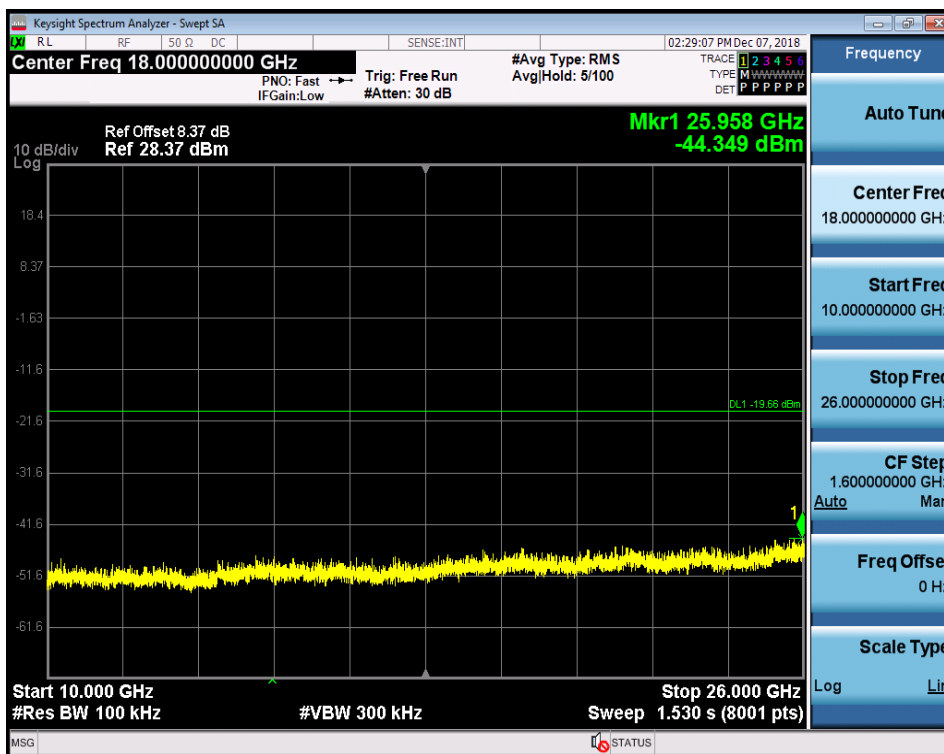


RF Conducted Spurious Emissions_DH5_2480


Pref



CSE_1

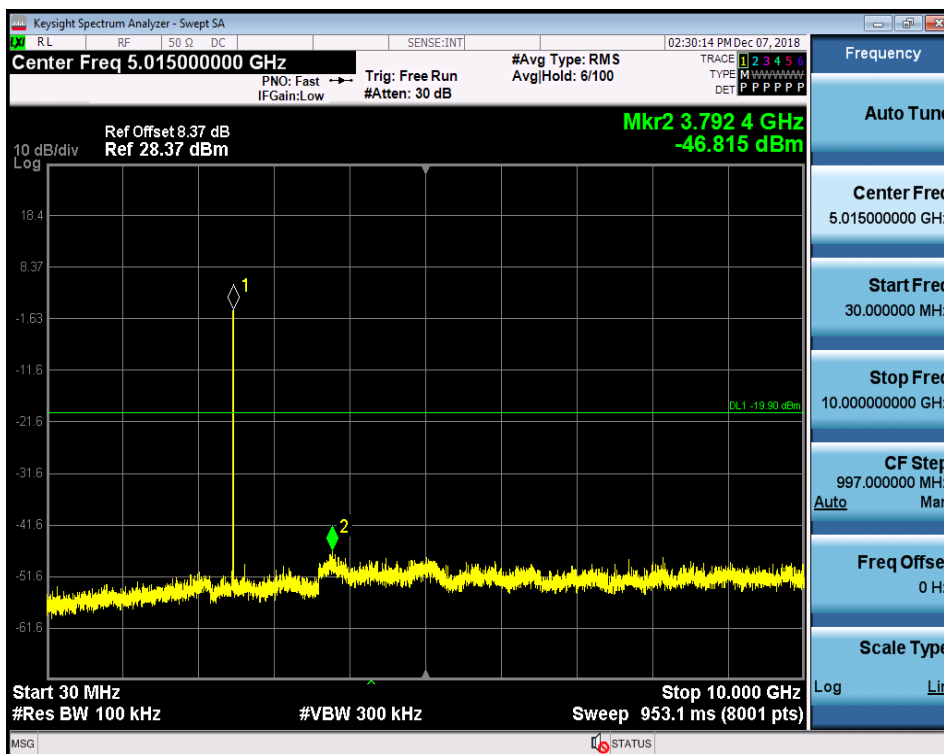

CSE_2

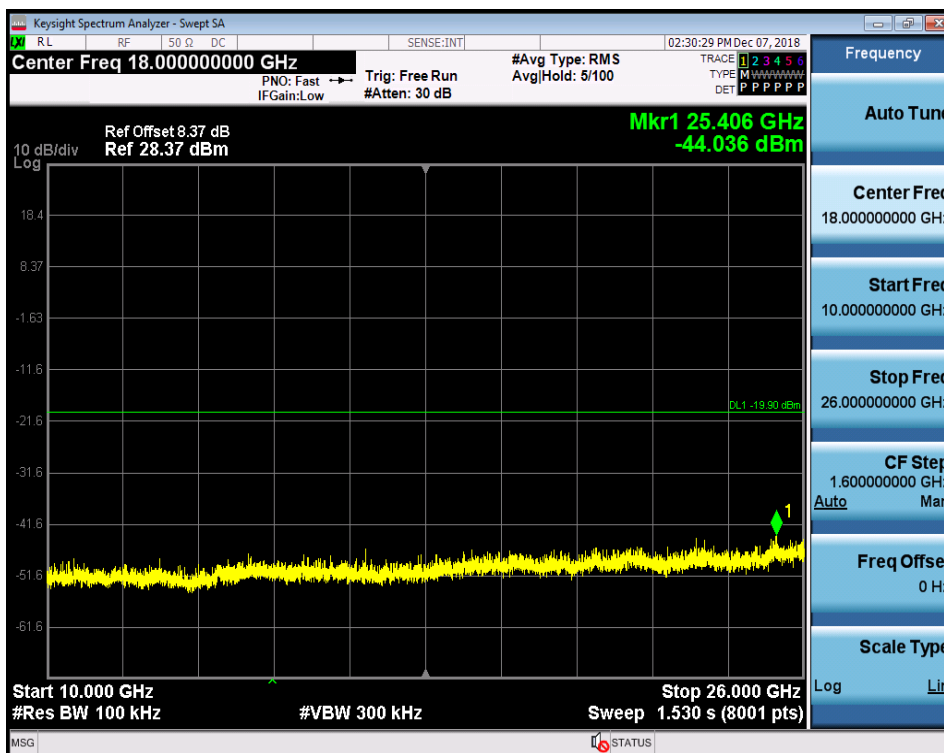


RF Conducted Spurious Emissions_2DH5_2402


Pref



CSE_1

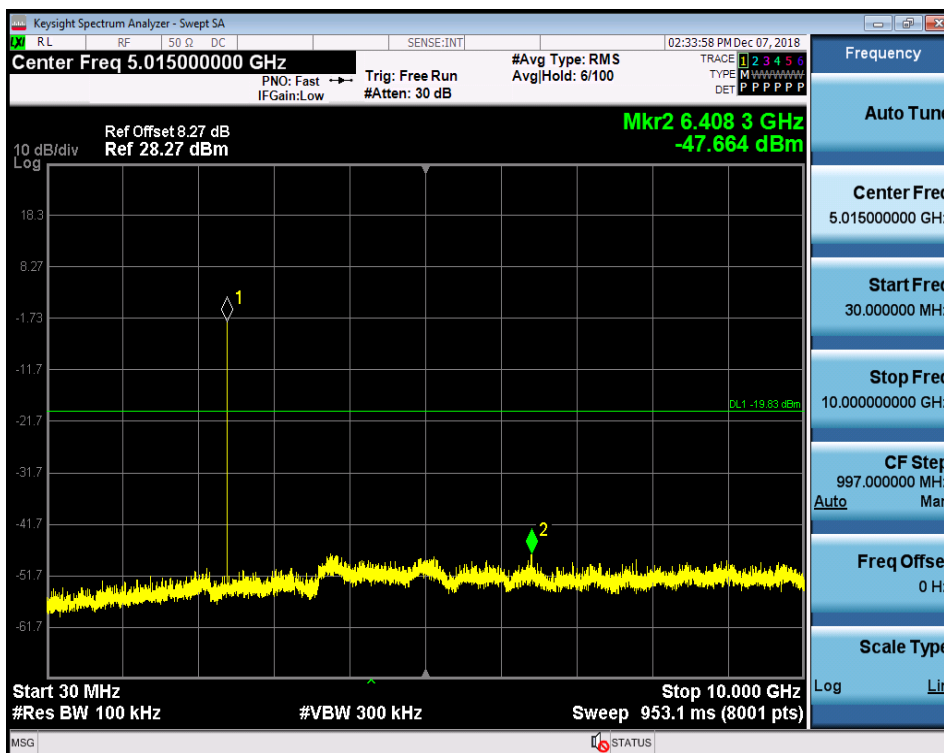

CSE_2

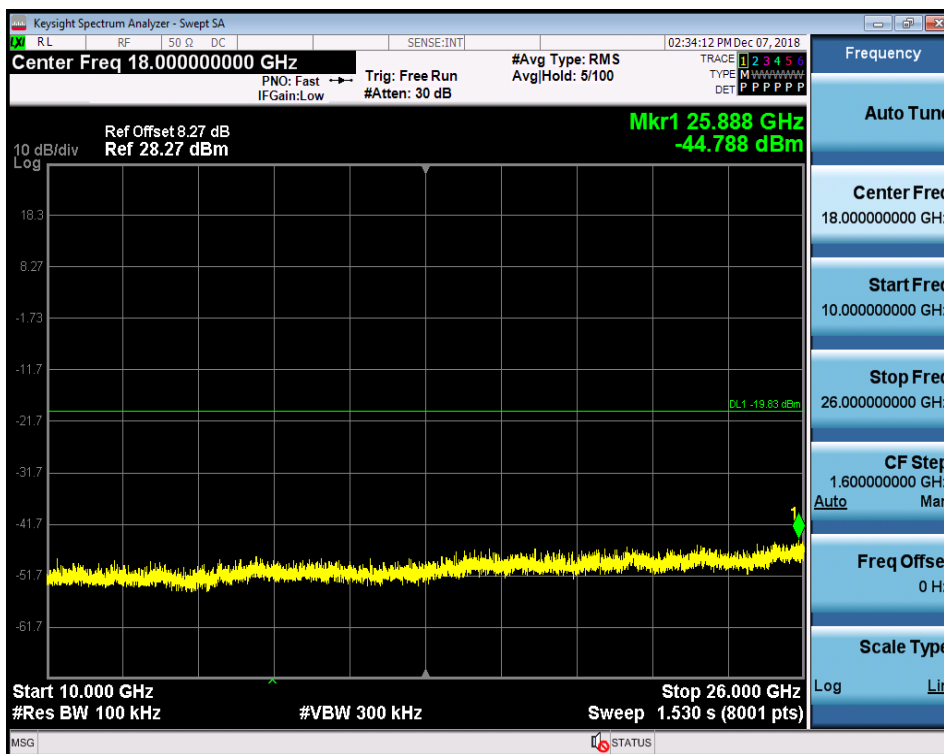


RF Conducted Spurious Emissions_2DH5_2441


Pref



CSE_1

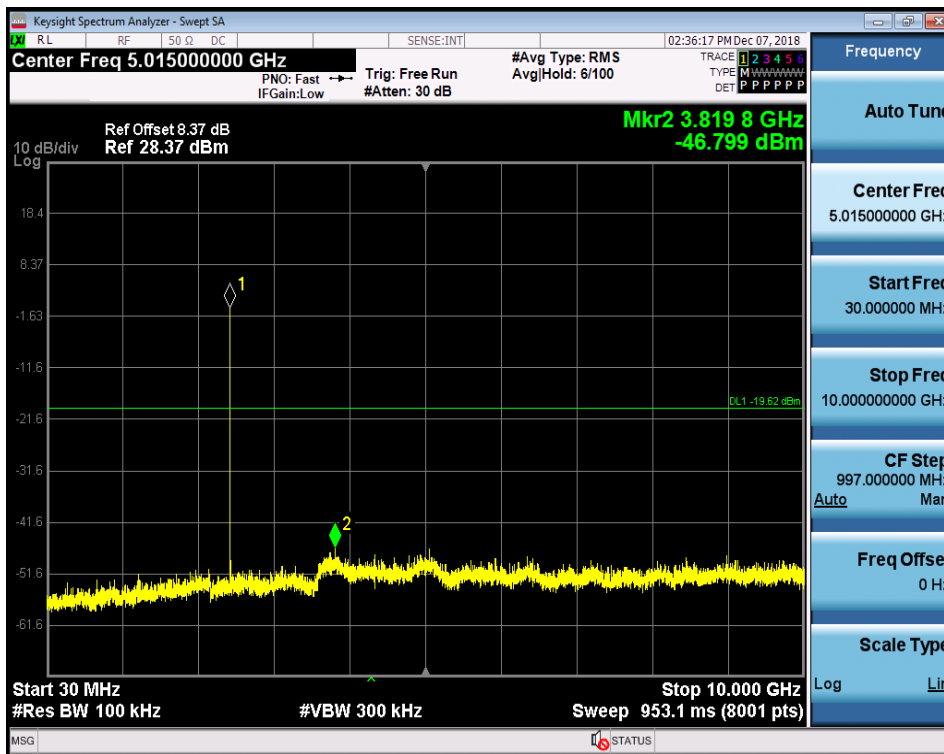

CSE_2

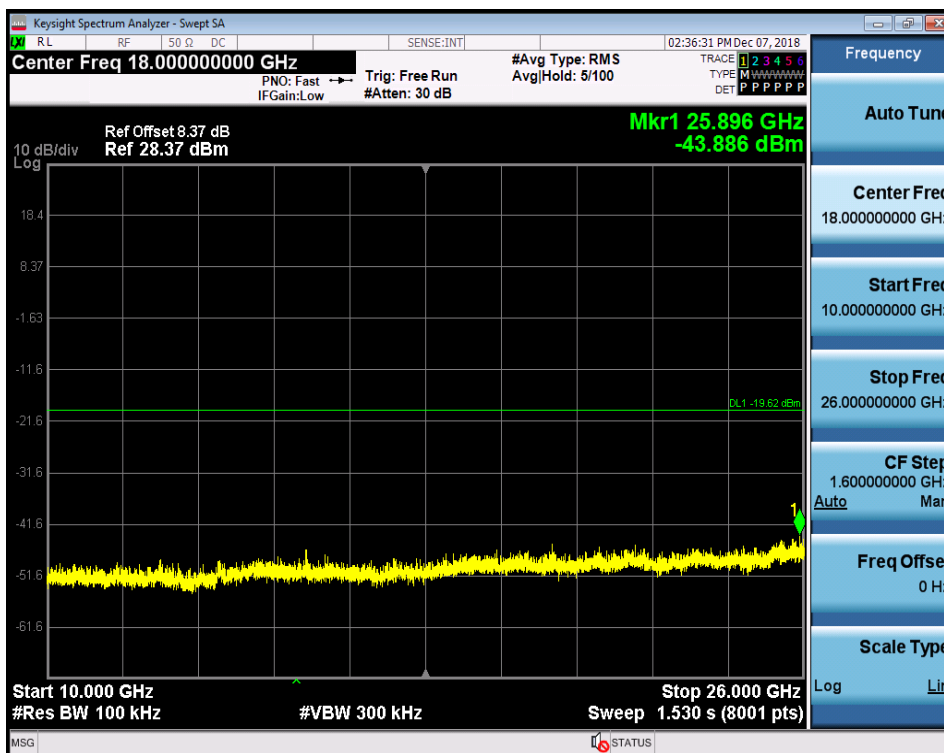


RF Conducted Spurious Emissions_2DH5_2480


Pref



CSE_1

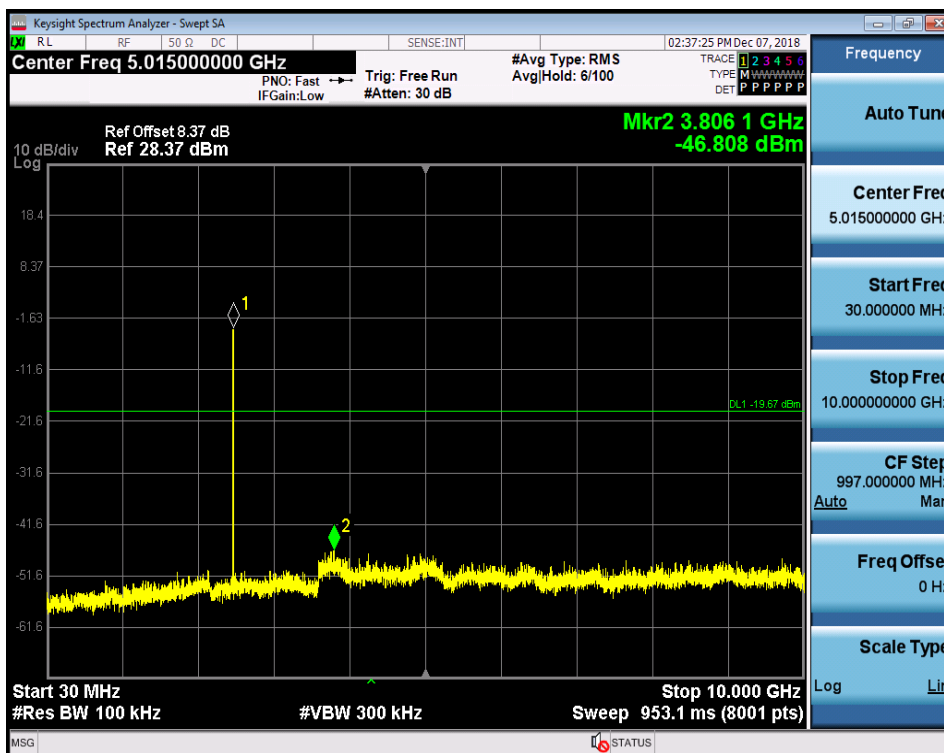


CSE_2

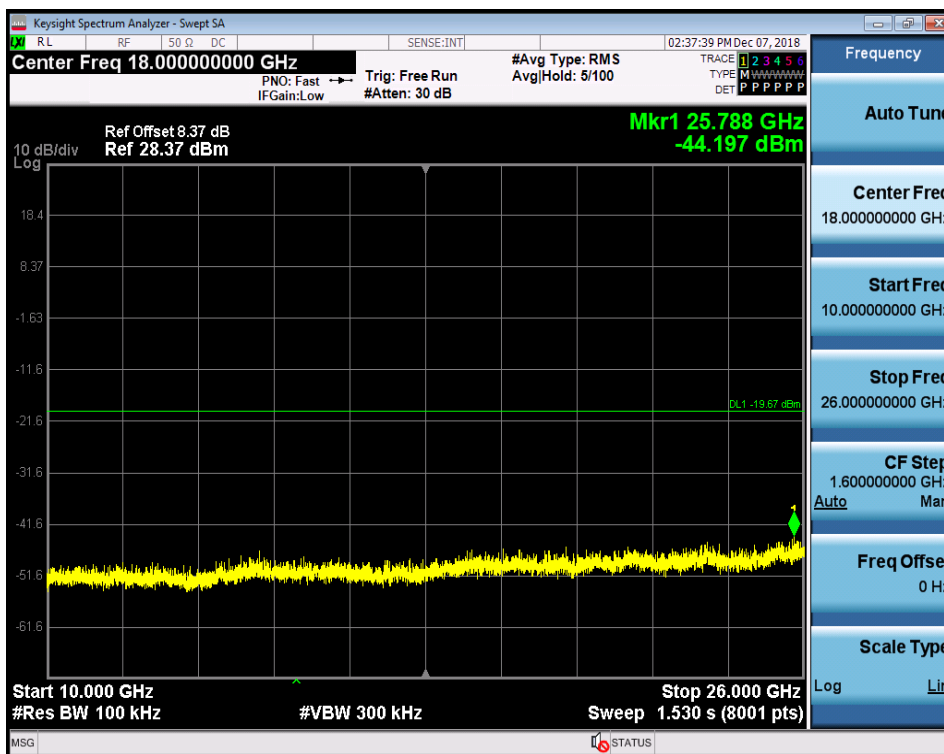


RF Conducted Spurious Emissions_3DH5_2402


Pref

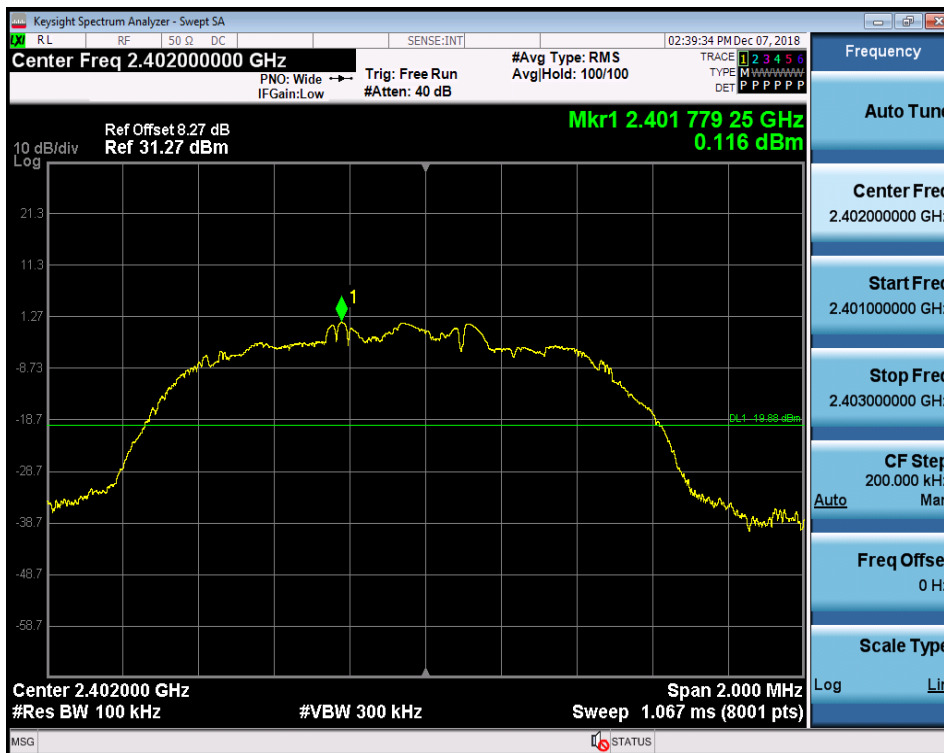

CSE_1

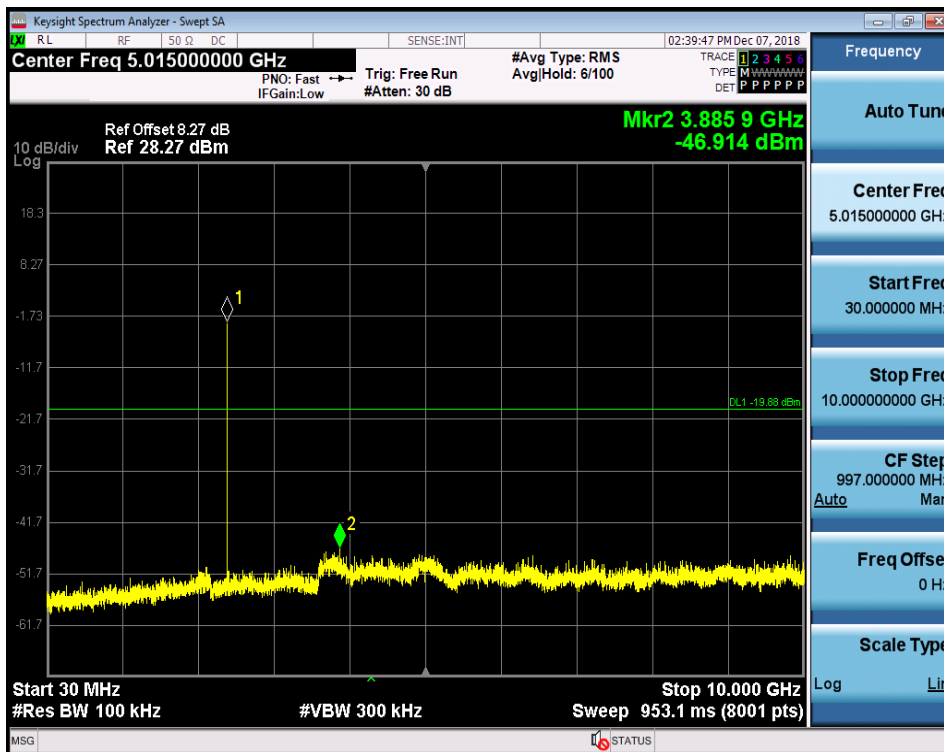

CSE_2

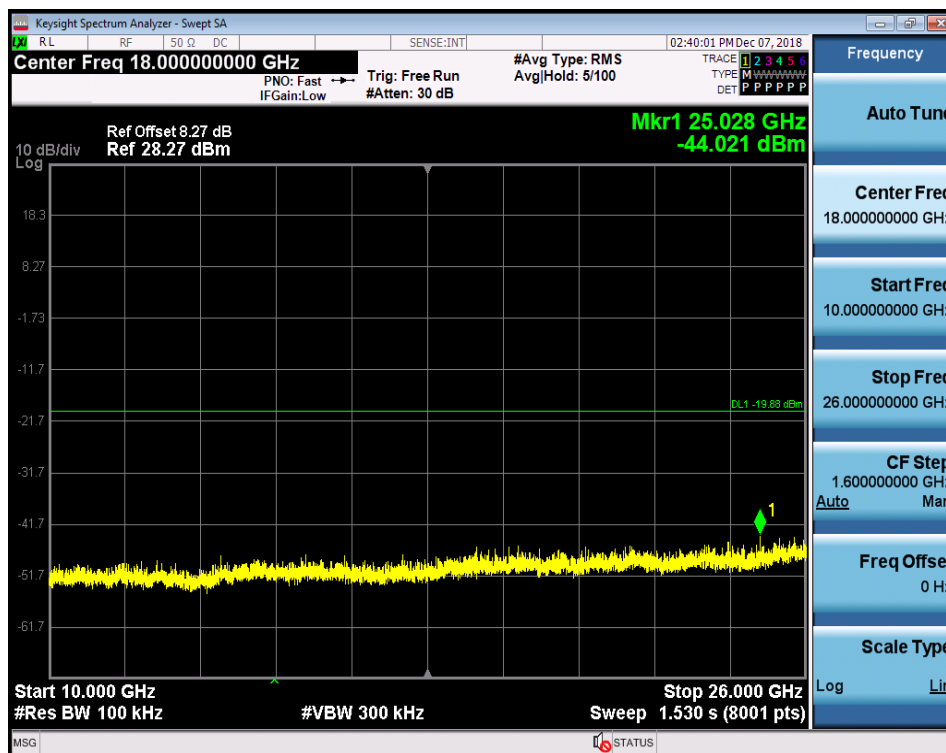


RF Conducted Spurious Emissions_3DH5_2441


Pref



CSE_1

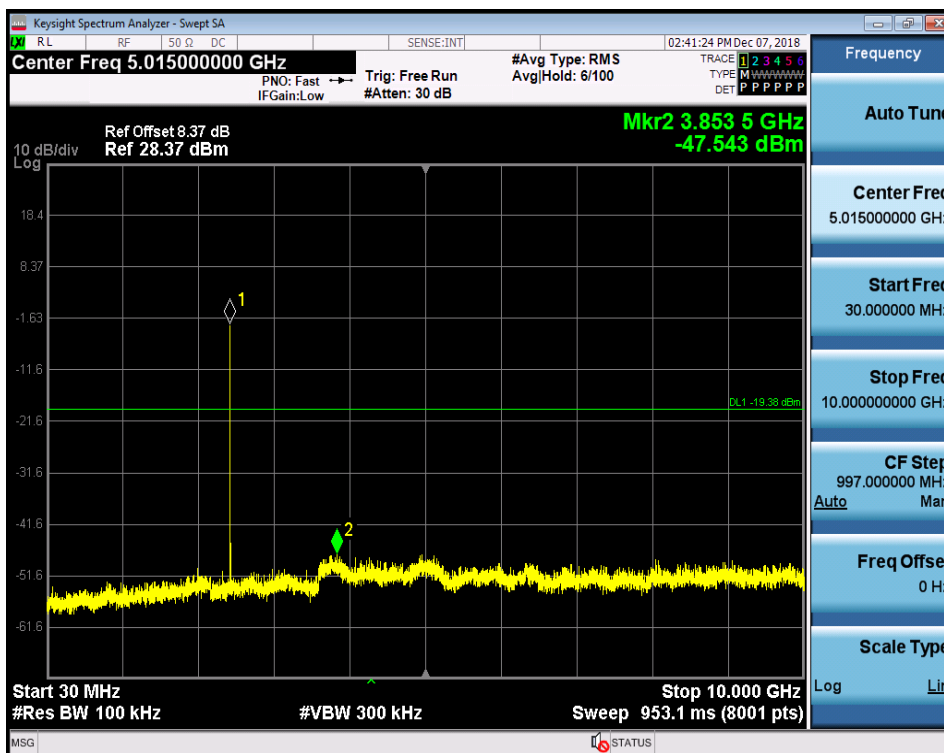


CSE_2

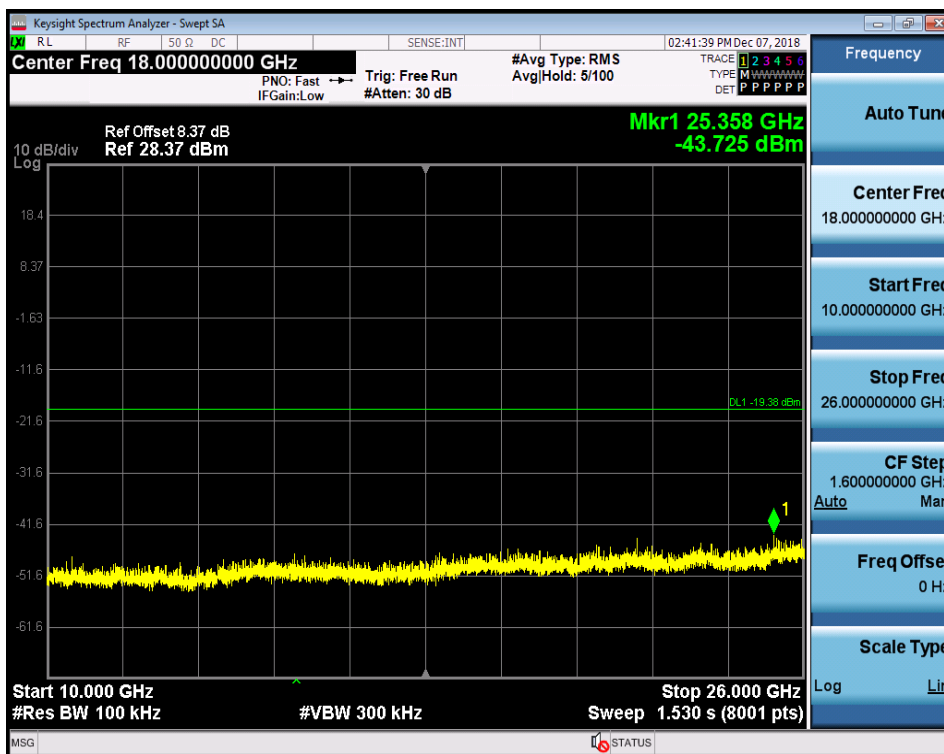


RF Conducted Spurious Emissions_3DH5_2480

Pref

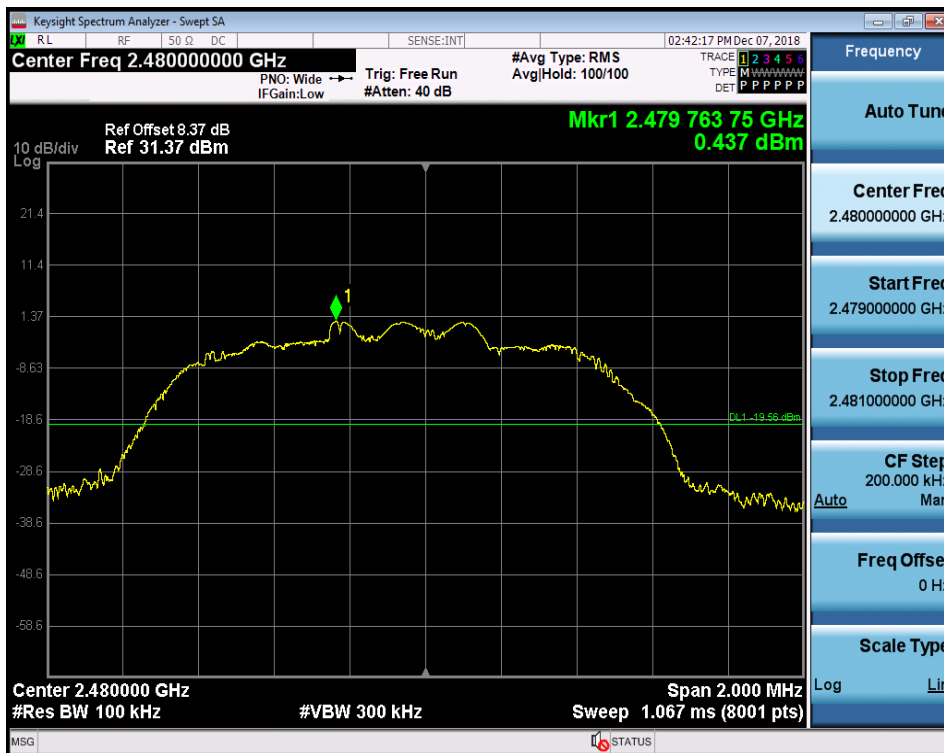

CSE_1

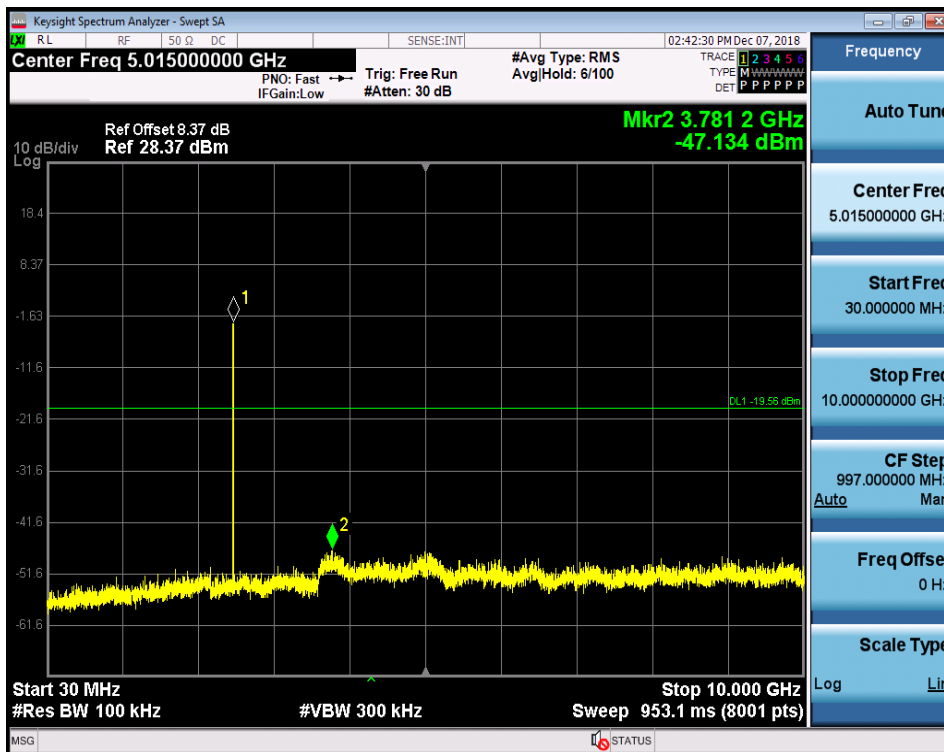




SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch

Report No.: GZEM181100248301
Page: 118 of 118

CSE_2

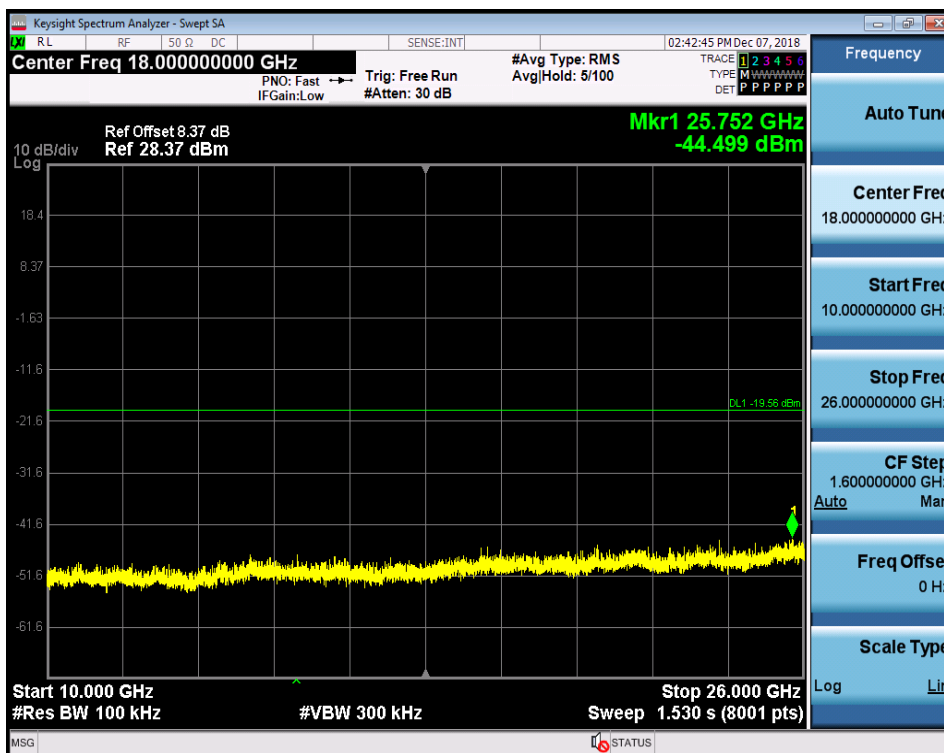

--End of Report--