

Appendix Test Data

Report No.:	1812C50673812503-01	Test Sample No.:	1-2-2
Start Test Date:	2025-12-23	Finish Test Date:	2025-12-25
Test Engineer:	<i>Alex Peng</i>	Auditor:	<i>Justin Feng</i>
Temperature:	25.8°C	Relative Humidity:	36%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	26.080	5167.360	5193.440	---	---
11A	Ant1	5220	27.080	5206.400	5233.480	---	---
11A	Ant1	5240	25.960	5226.760	5252.720	---	---
11A	Ant1	5260	26.280	5246.680	5272.960	---	---
11A	Ant1	5300	26.720	5286.920	5313.640	---	---
11A	Ant1	5320	26.120	5306.680	5332.800	---	---
11A	Ant1	5500	26.280	5486.840	5513.120	---	---
11A	Ant1	5580	27.000	5566.560	5593.560	---	---
11A	Ant1	5700	27.000	5686.680	5713.680	---	---
11A	Ant1	5745	25.520	5731.960	5757.480	---	---
11A	Ant1	5785	26.760	5771.200	5797.960	---	---
11A	Ant1	5825	26.440	5811.920	5838.360	---	---
11N20SISO	Ant1	5180	26.400	5166.840	5193.240	---	---
11N20SISO	Ant1	5220	27.120	5206.720	5233.840	---	---
11N20SISO	Ant1	5240	27.840	5225.920	5253.760	---	---
11N20SISO	Ant1	5260	27.400	5246.320	5273.720	---	---
11N20SISO	Ant1	5300	28.040	5285.840	5313.880	---	---
11N20SISO	Ant1	5320	26.360	5306.680	5333.040	---	---
11N20SISO	Ant1	5500	28.840	5486.000	5514.840	---	---
11N20SISO	Ant1	5580	27.640	5566.280	5593.920	---	---
11N20SISO	Ant1	5700	28.560	5685.680	5714.240	---	---
11N20SISO	Ant1	5745	27.520	5730.880	5758.400	---	---
11N20SISO	Ant1	5785	28.080	5771.000	5799.080	---	---
11N20SISO	Ant1	5825	27.560	5811.520	5839.080	---	---

11N40SISO	Ant1	5190	47.120	5166.560	5213.680	---	---
11N40SISO	Ant1	5230	47.520	5206.320	5253.840	---	---
11N40SISO	Ant1	5270	48.480	5245.120	5293.600	---	---
11N40SISO	Ant1	5310	47.040	5286.240	5333.280	---	---
11N40SISO	Ant1	5510	47.680	5486.560	5534.240	---	---
11N40SISO	Ant1	5550	47.680	5526.080	5573.760	---	---
11N40SISO	Ant1	5670	49.120	5645.280	5694.400	---	---
11N40SISO	Ant1	5755	48.640	5730.600	5779.240	---	---
11N40SISO	Ant1	5795	48.160	5771.320	5819.480	---	---
11AC20SISO	Ant1	5180	28.120	5166.280	5194.400	---	---
11AC20SISO	Ant1	5220	27.440	5205.680	5233.120	---	---
11AC20SISO	Ant1	5240	26.320	5226.360	5252.680	---	---
11AC20SISO	Ant1	5260	28.440	5245.640	5274.080	---	---
11AC20SISO	Ant1	5300	29.040	5285.760	5314.800	---	---
11AC20SISO	Ant1	5320	27.840	5306.040	5333.880	---	---
11AC20SISO	Ant1	5500	27.480	5486.640	5514.120	---	---
11AC20SISO	Ant1	5580	27.440	5566.320	5593.760	---	---
11AC20SISO	Ant1	5700	28.920	5686.240	5715.160	---	---
11AC20SISO	Ant1	5745	27.600	5730.840	5758.440	---	---
11AC20SISO	Ant1	5785	28.000	5771.240	5799.240	---	---
11AC20SISO	Ant1	5825	27.400	5811.520	5838.920	---	---
11AC40SISO	Ant1	5190	48.400	5165.600	5214.000	---	---
11AC40SISO	Ant1	5230	47.120	5206.080	5253.200	---	---
11AC40SISO	Ant1	5270	47.280	5246.320	5293.600	---	---
11AC40SISO	Ant1	5310	47.280	5286.480	5333.760	---	---
11AC40SISO	Ant1	5510	47.600	5486.560	5534.160	---	---
11AC40SISO	Ant1	5550	48.960	5525.760	5574.720	---	---
11AC40SISO	Ant1	5670	48.880	5646.480	5695.360	---	---
11AC40SISO	Ant1	5755	48.560	5730.440	5779.000	---	---
11AC40SISO	Ant1	5795	49.840	5770.200	5820.040	---	---
11AC80SISO	Ant1	5210	86.880	5166.480	5253.360	---	---
11AC80SISO	Ant1	5290	87.840	5245.680	5333.520	---	---
11AC80SISO	Ant1	5530	88.640	5486.800	5575.440	---	---
11AC80SISO	Ant1	5775	88.640	5730.200	5818.840	---	---
11AX20SISO	Ant1	5180	29.480	5166.520	5196.000	---	---
11AX20SISO	Ant1	5220	26.920	5207.680	5234.600	---	---
11AX20SISO	Ant1	5240	27.080	5227.120	5254.200	---	---
11AX20SISO	Ant1	5260	26.440	5247.680	5274.120	---	---
11AX20SISO	Ant1	5300	27.720	5287.120	5314.840	---	---
11AX20SISO	Ant1	5320	28.440	5307.320	5335.760	---	---
11AX20SISO	Ant1	5500	28.320	5486.600	5514.920	---	---
11AX20SISO	Ant1	5580	27.800	5567.920	5595.720	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX20SISO	Ant1	5700	28.960	5686.280	5715.240	---	---
11AX20SISO	Ant1	5745	28.360	5732.160	5760.520	---	---
11AX20SISO	Ant1	5785	29.880	5771.040	5800.920	---	---
11AX20SISO	Ant1	5825	28.520	5811.640	5840.160	---	---
11AX40SISO	Ant1	5190	45.520	5167.760	5213.280	---	---
11AX40SISO	Ant1	5230	46.000	5206.720	5252.720	---	---
11AX40SISO	Ant1	5270	61.200	5237.520	5298.720	---	---
11AX40SISO	Ant1	5310	52.080	5286.240	5338.320	---	---
11AX40SISO	Ant1	5510	45.840	5486.960	5532.800	---	---
11AX40SISO	Ant1	5550	48.400	5526.000	5574.400	---	---
11AX40SISO	Ant1	5670	48.000	5646.320	5694.320	---	---
11AX40SISO	Ant1	5755	46.800	5731.560	5778.360	---	---
11AX40SISO	Ant1	5795	45.760	5771.640	5817.400	---	---
11AX80SISO	Ant1	5210	85.280	5167.600	5252.880	---	---
11AX80SISO	Ant1	5290	89.440	5244.720	5334.160	---	---
11AX80SISO	Ant1	5530	88.000	5486.160	5574.160	---	---
11AX80SISO	Ant1	5775	89.120	5730.360	5819.480	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




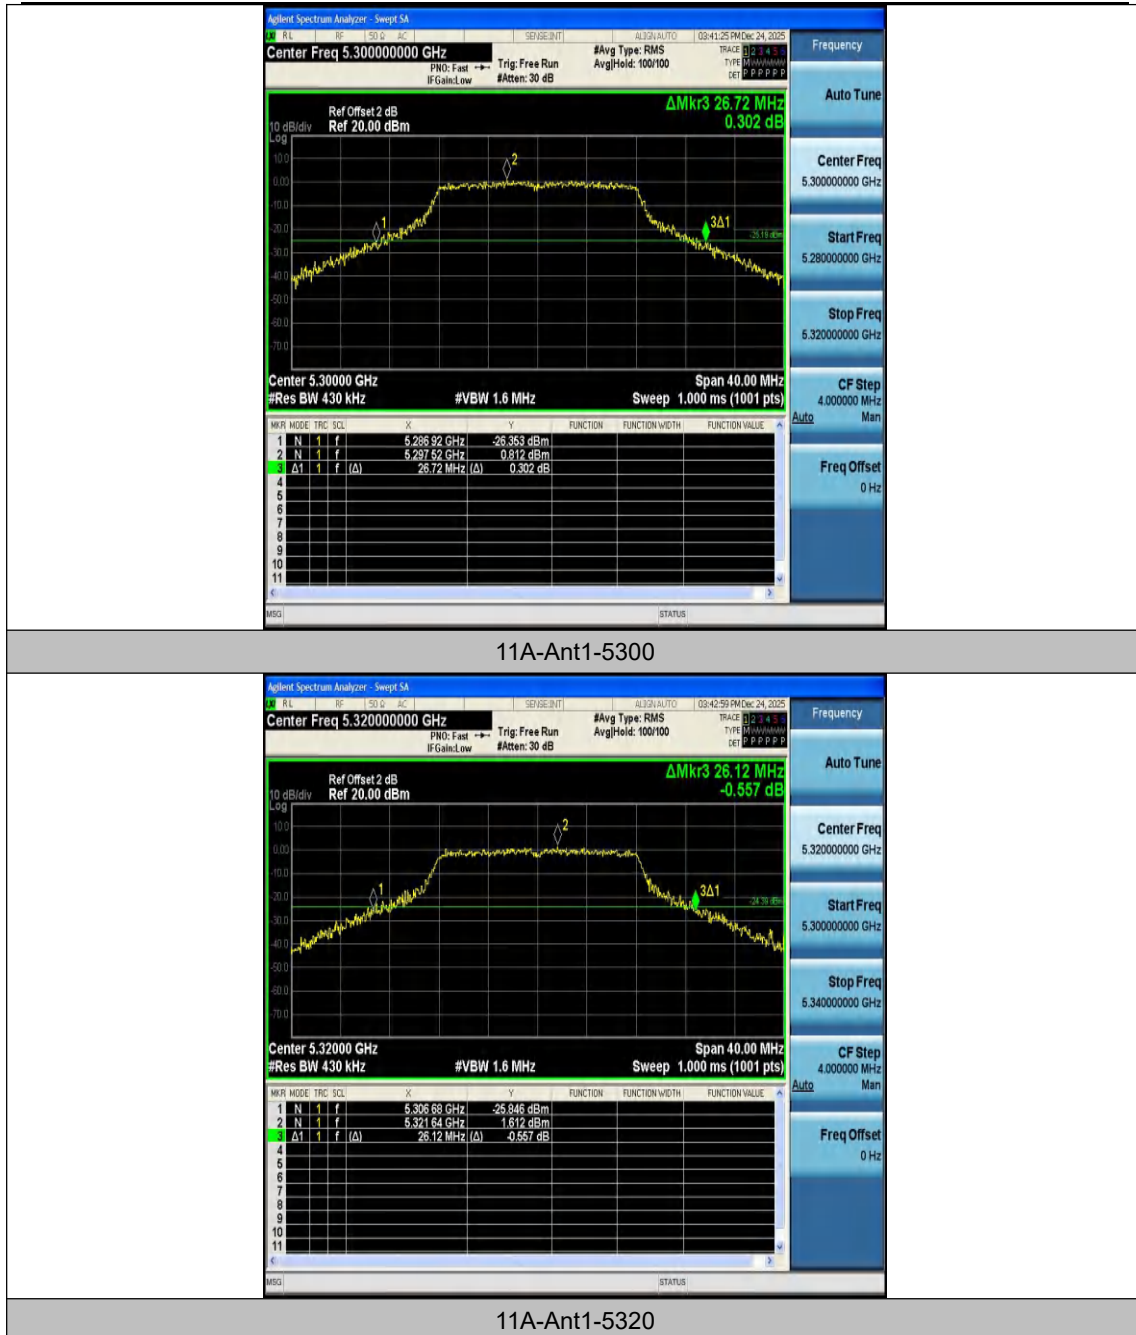


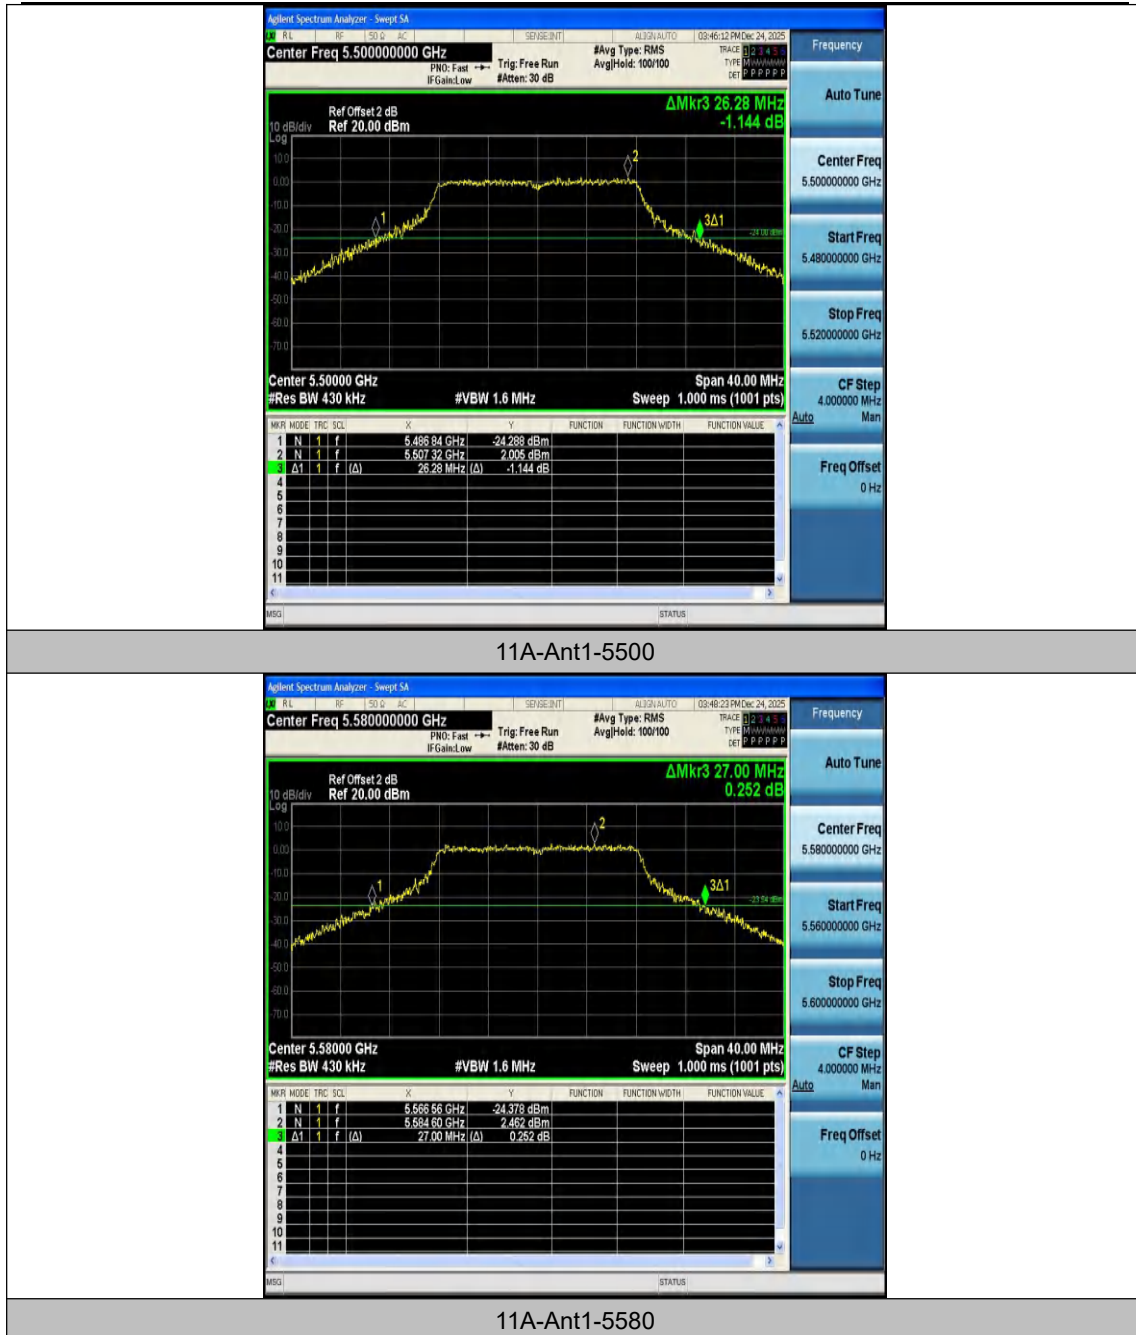








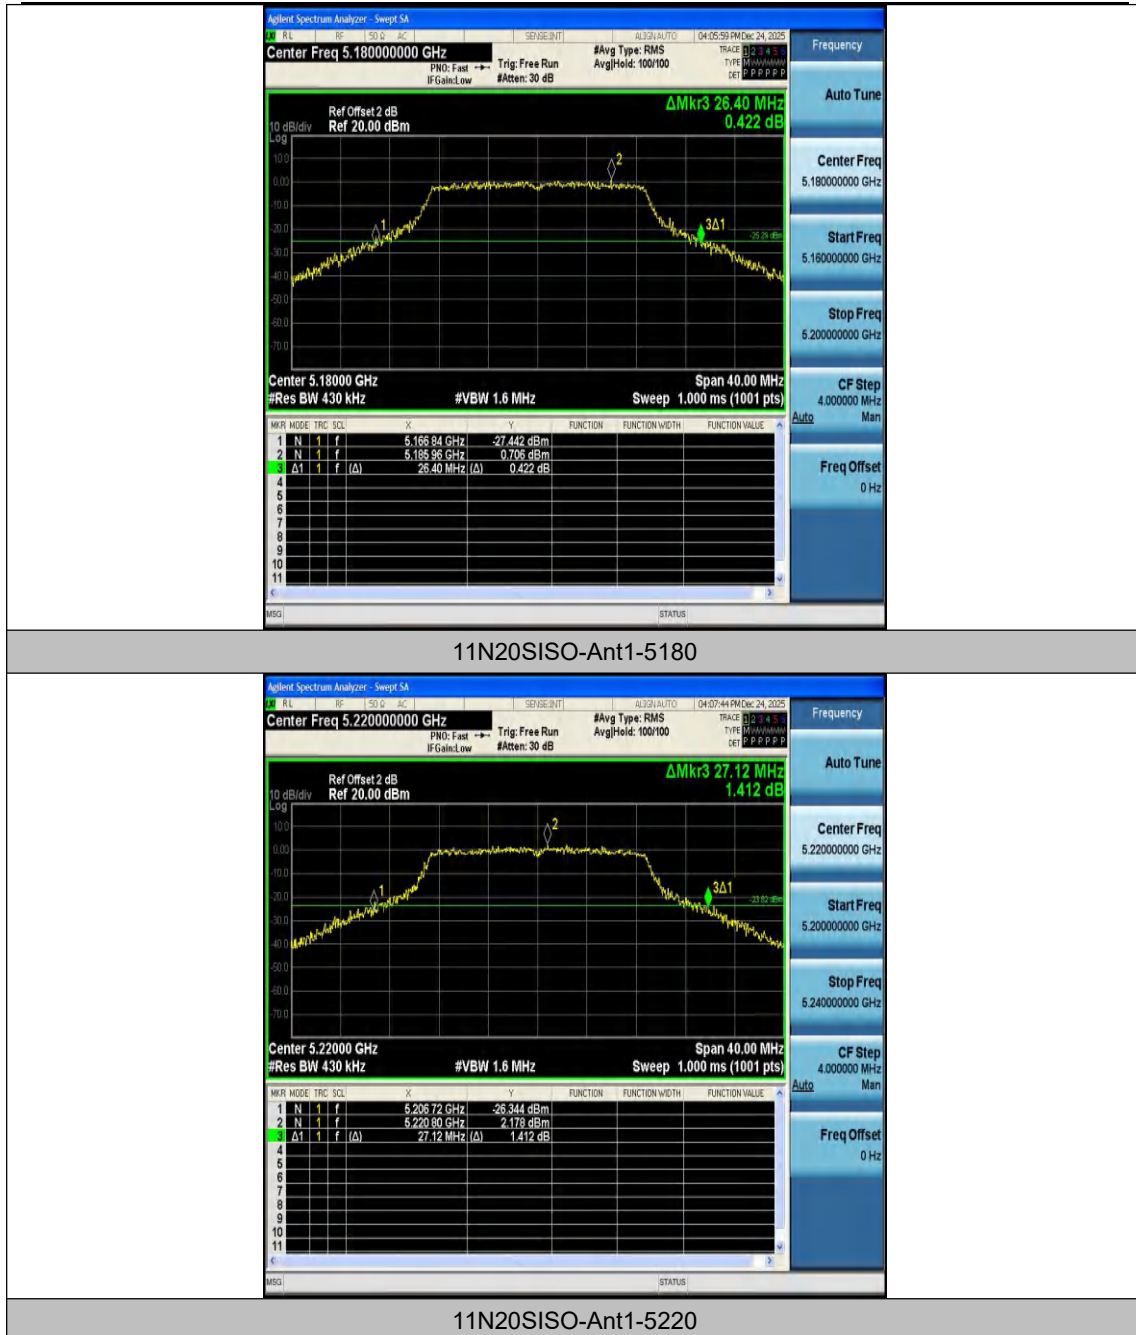


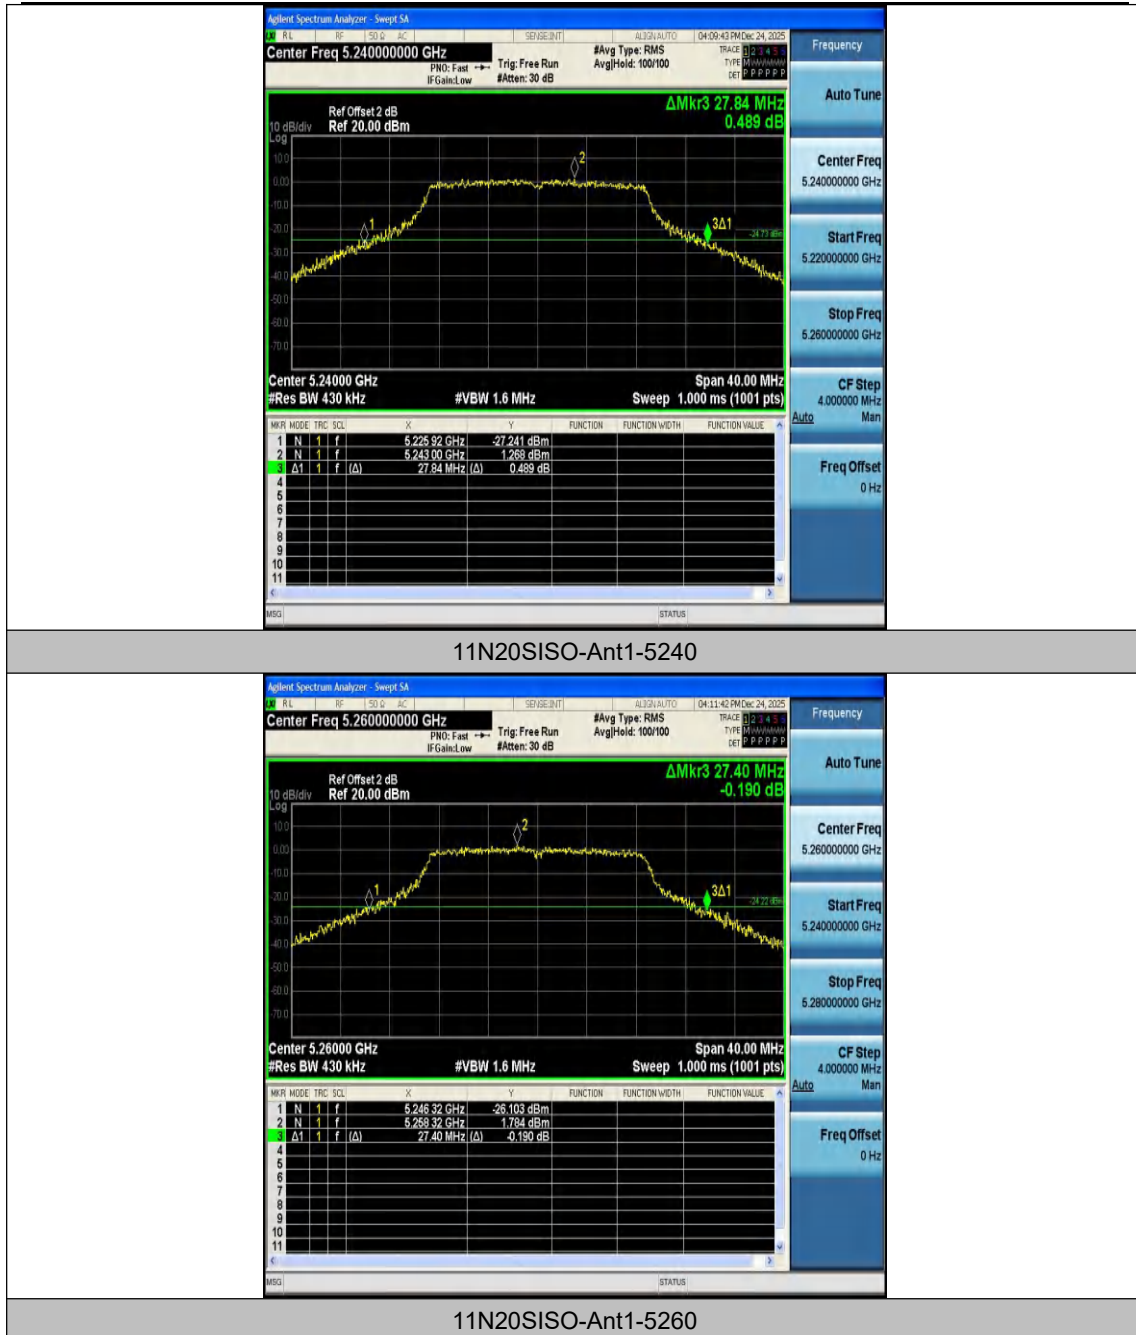

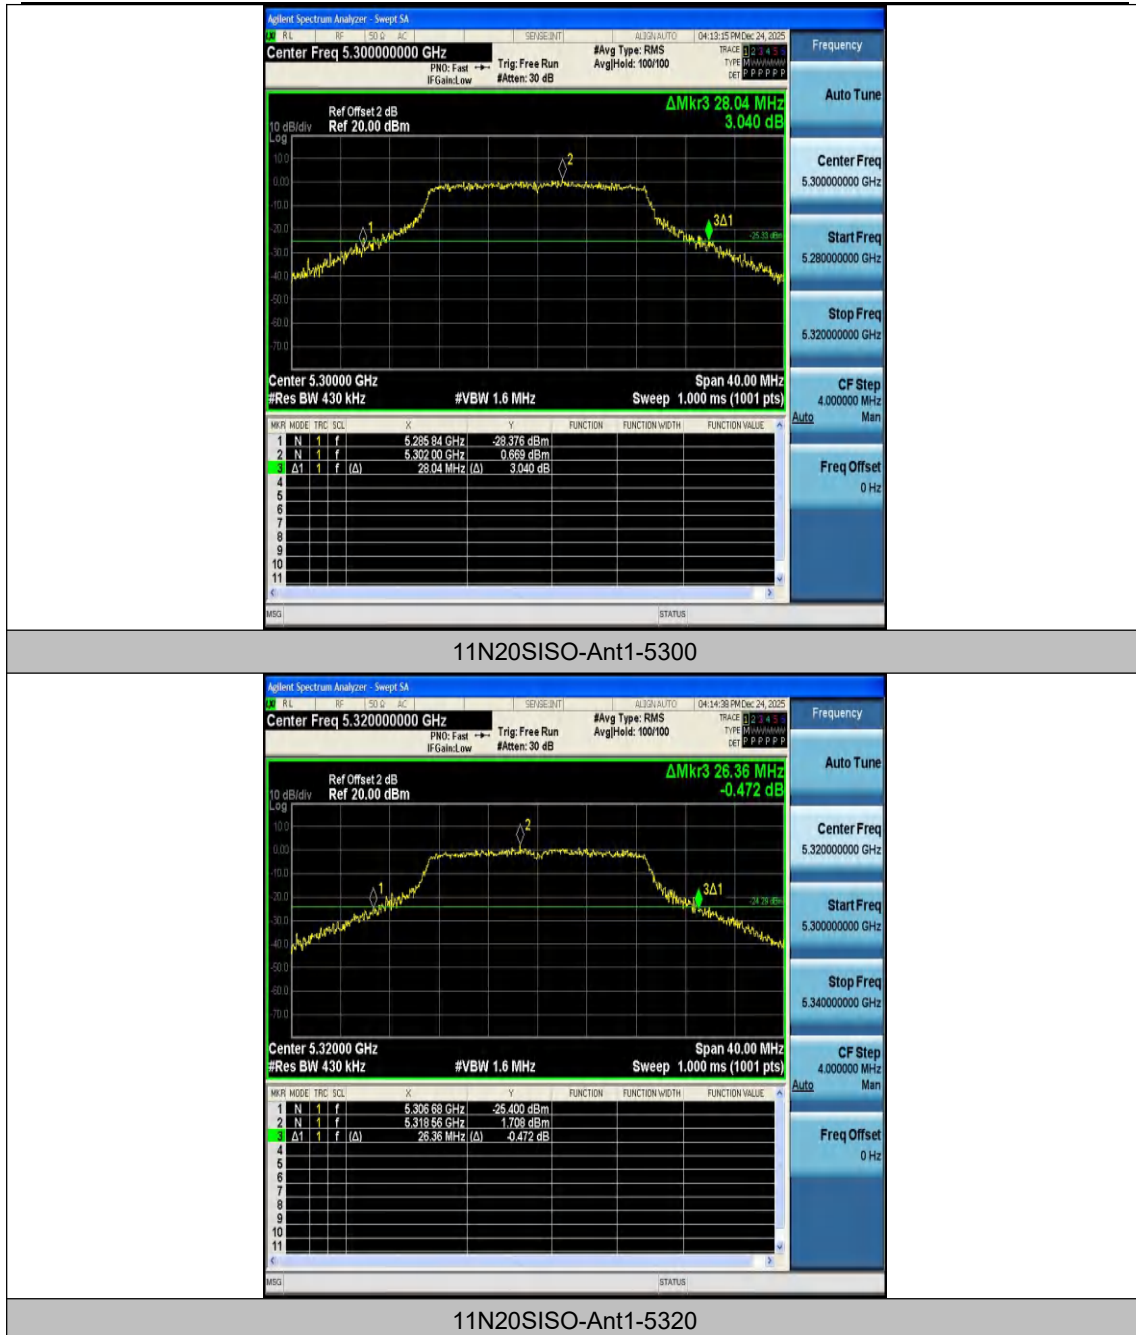


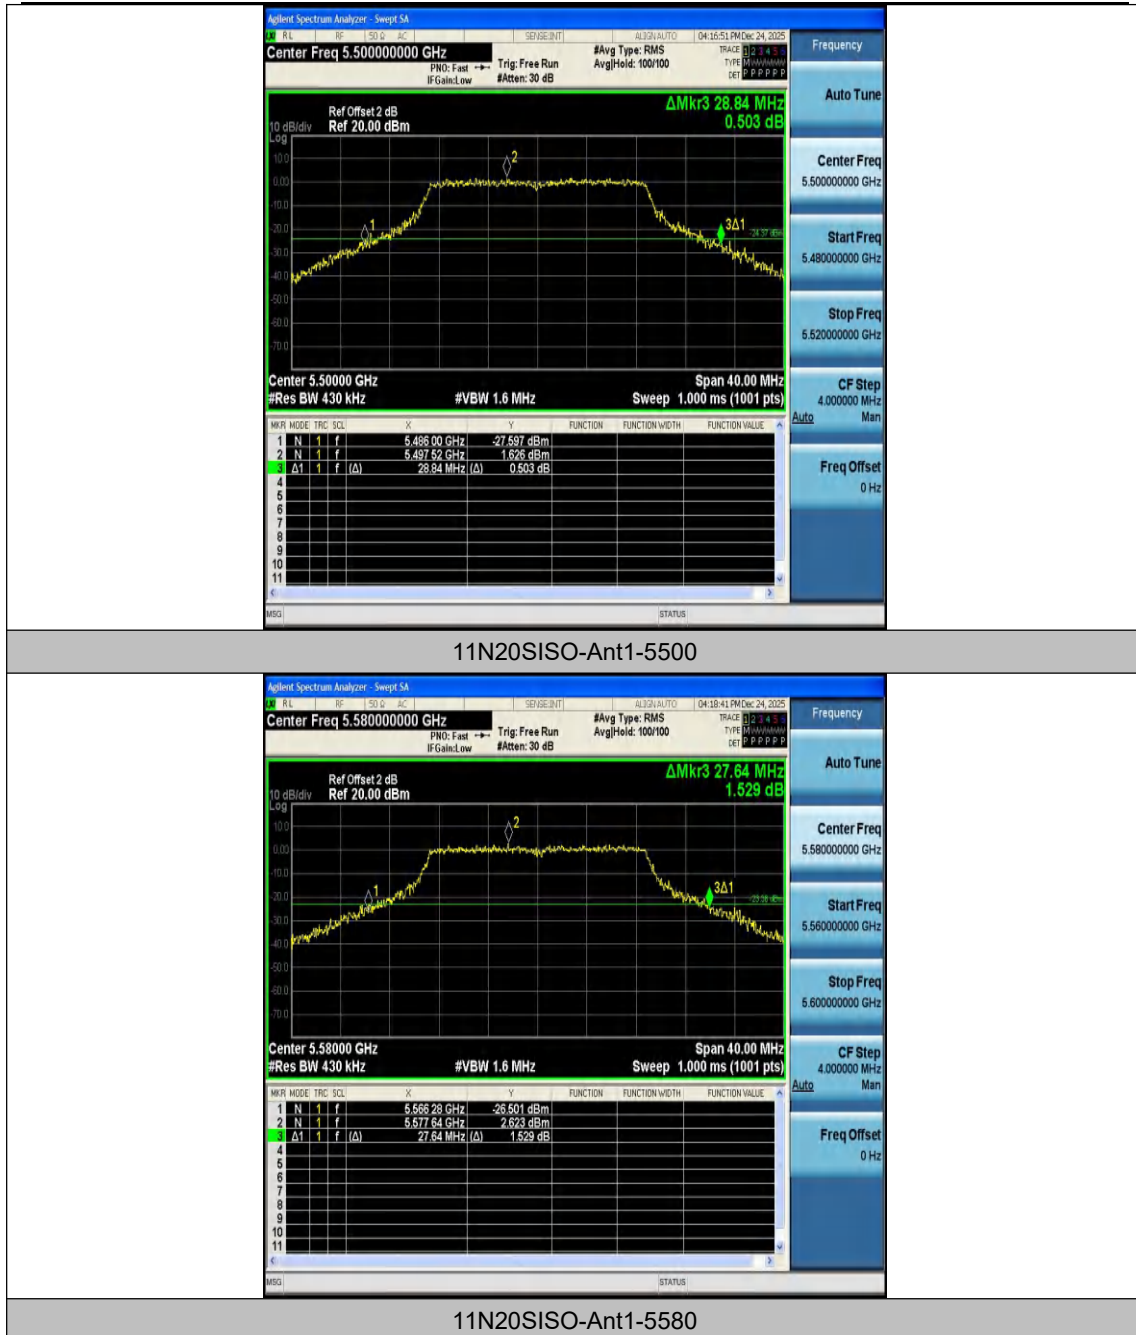


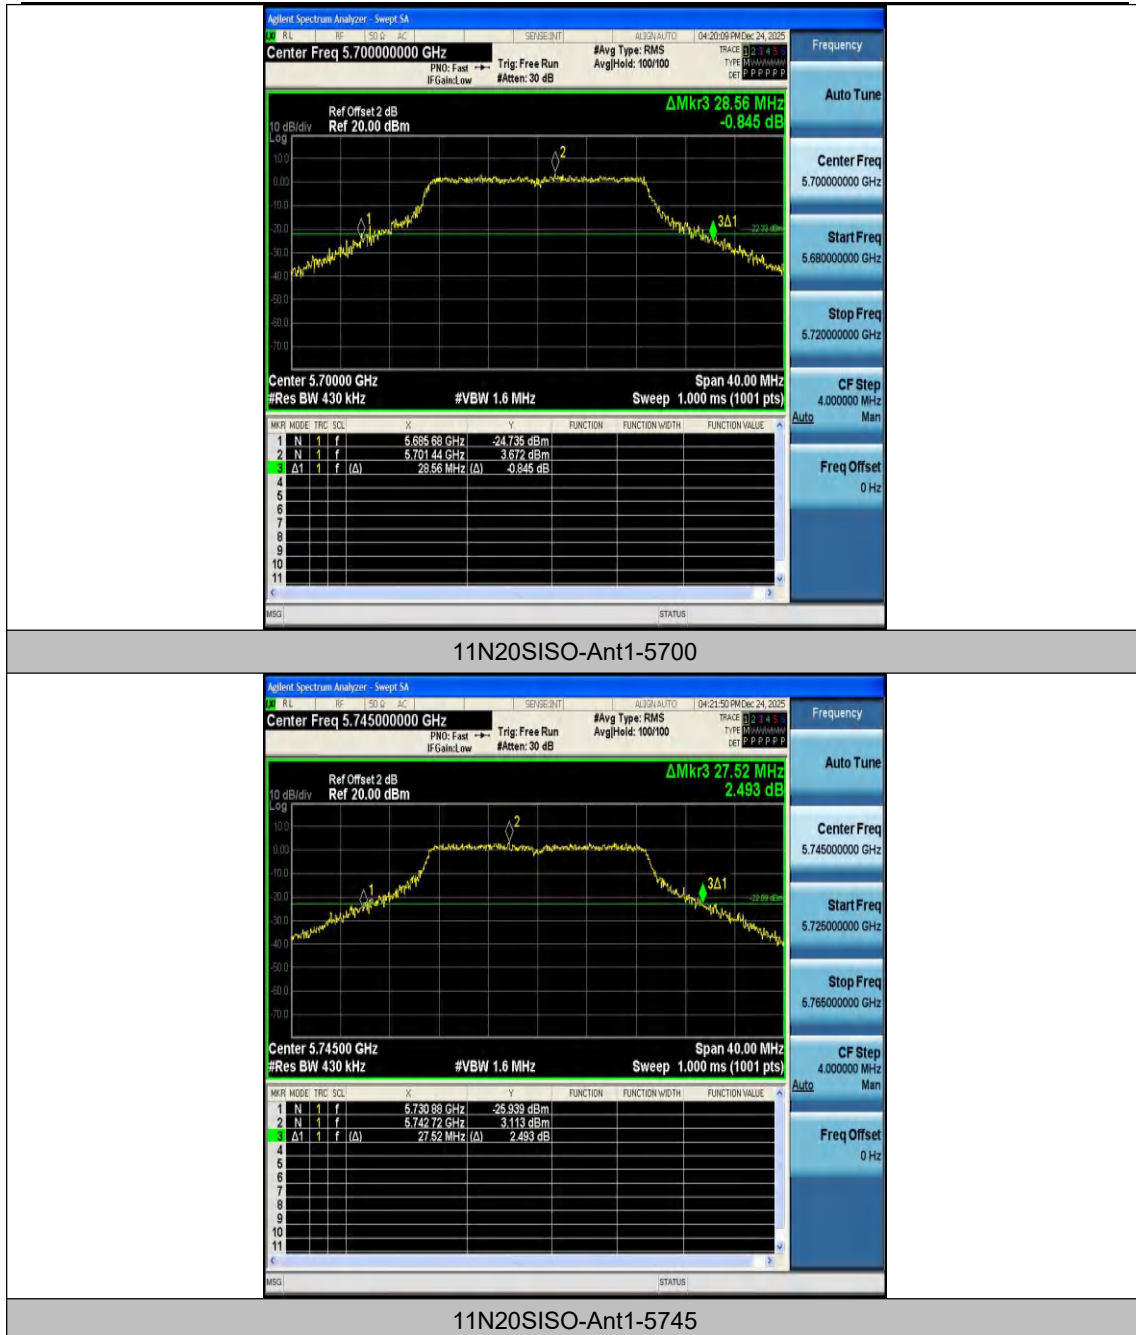


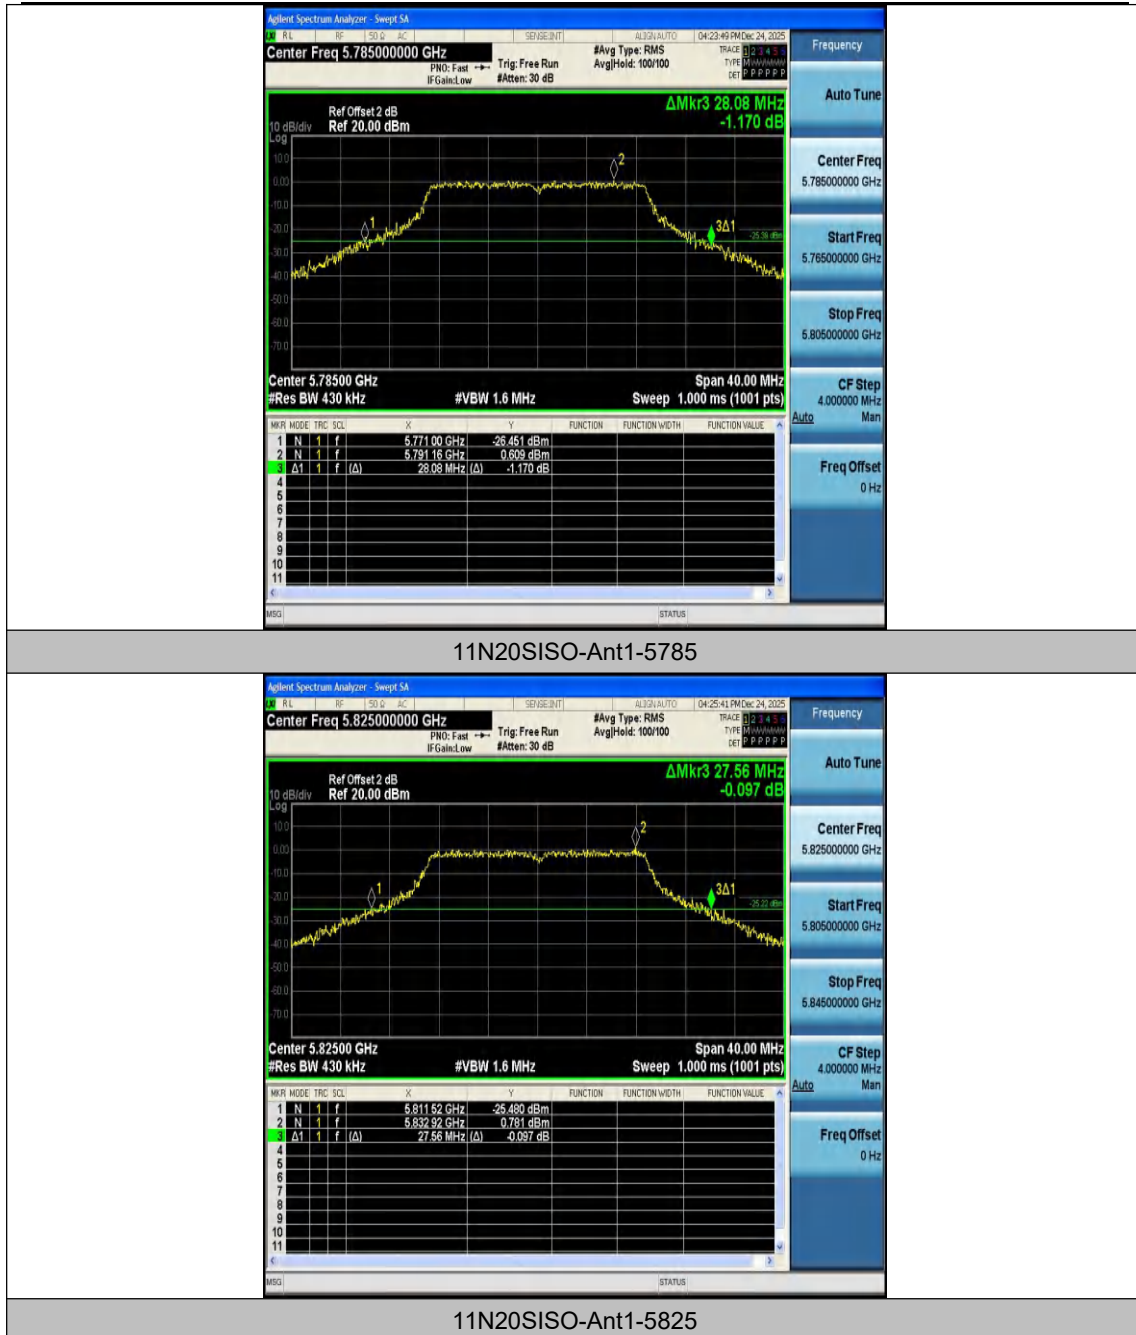





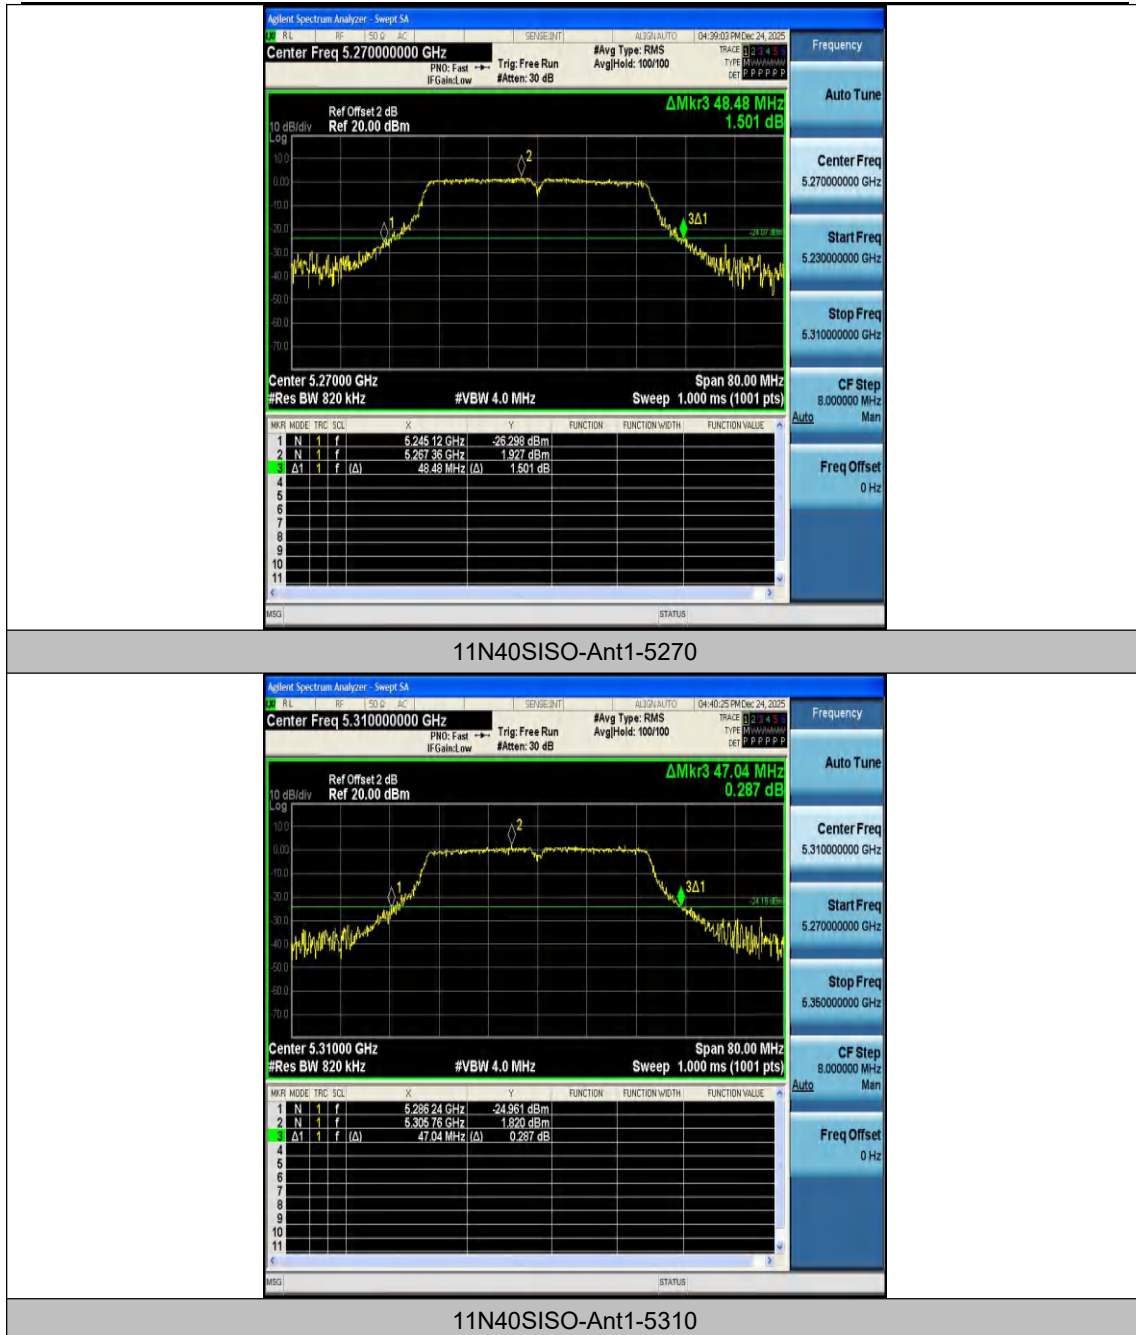


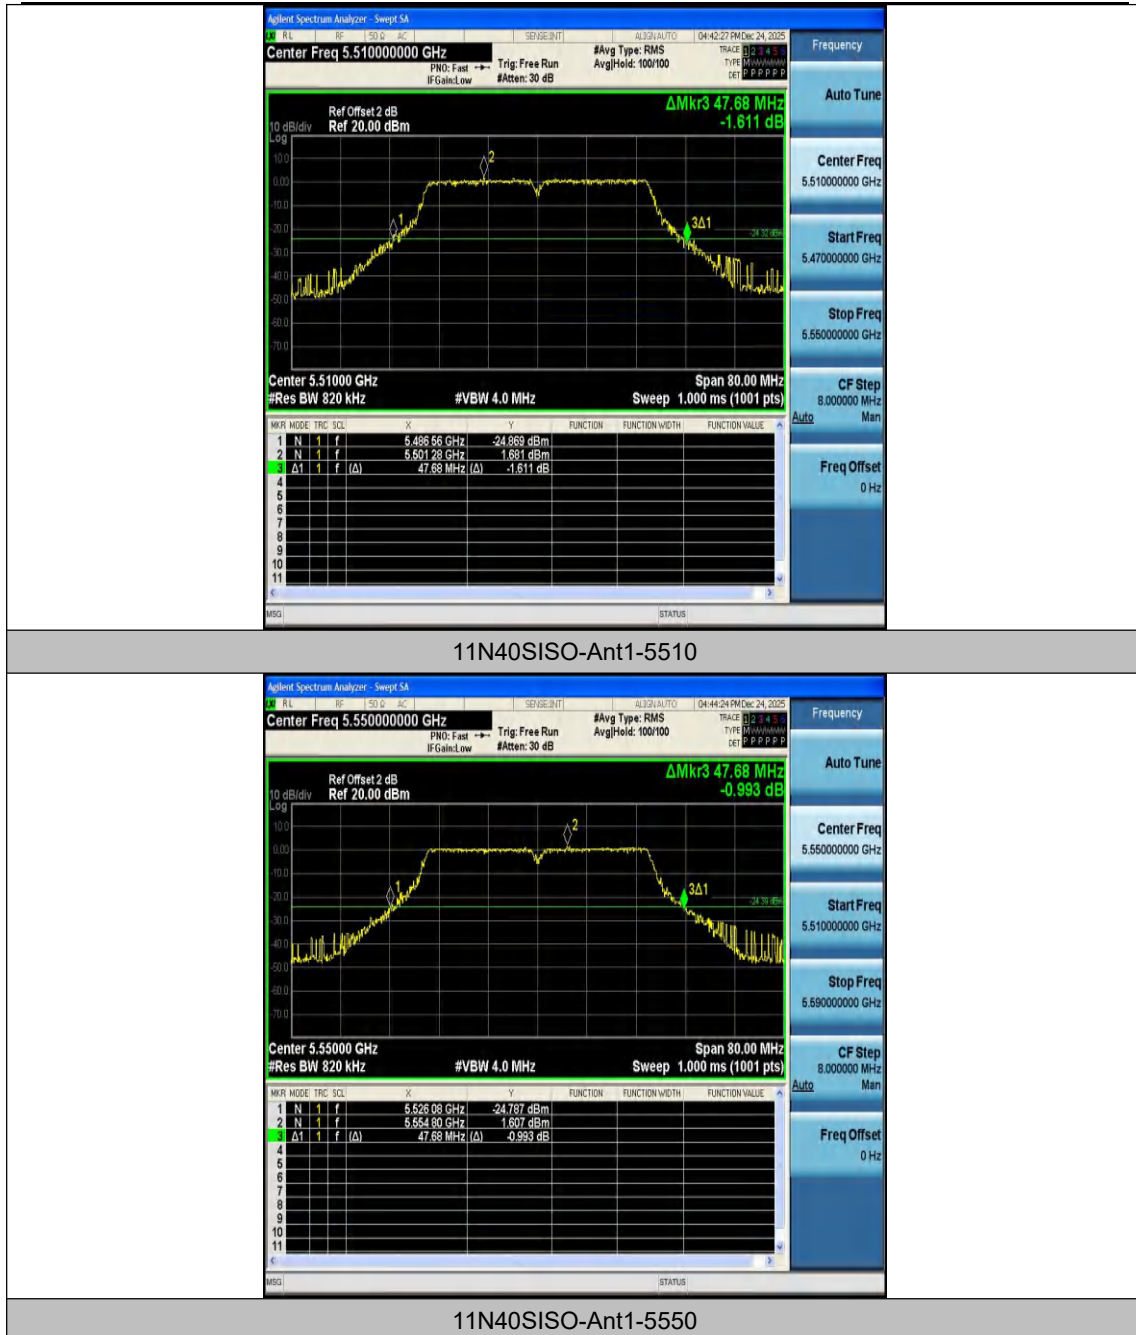


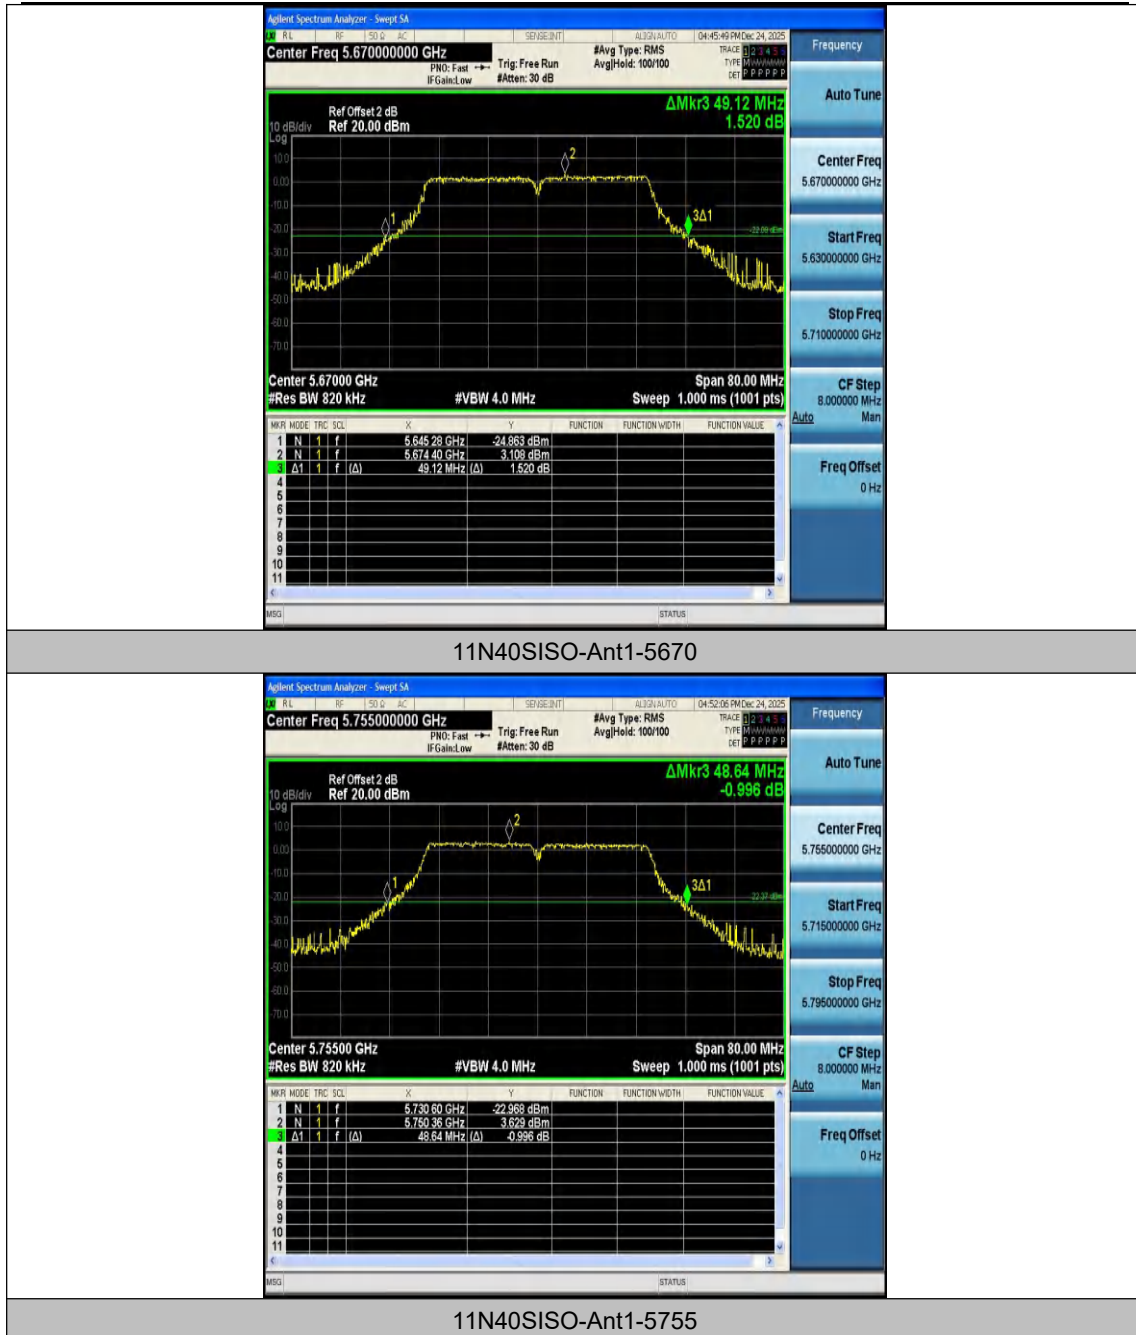


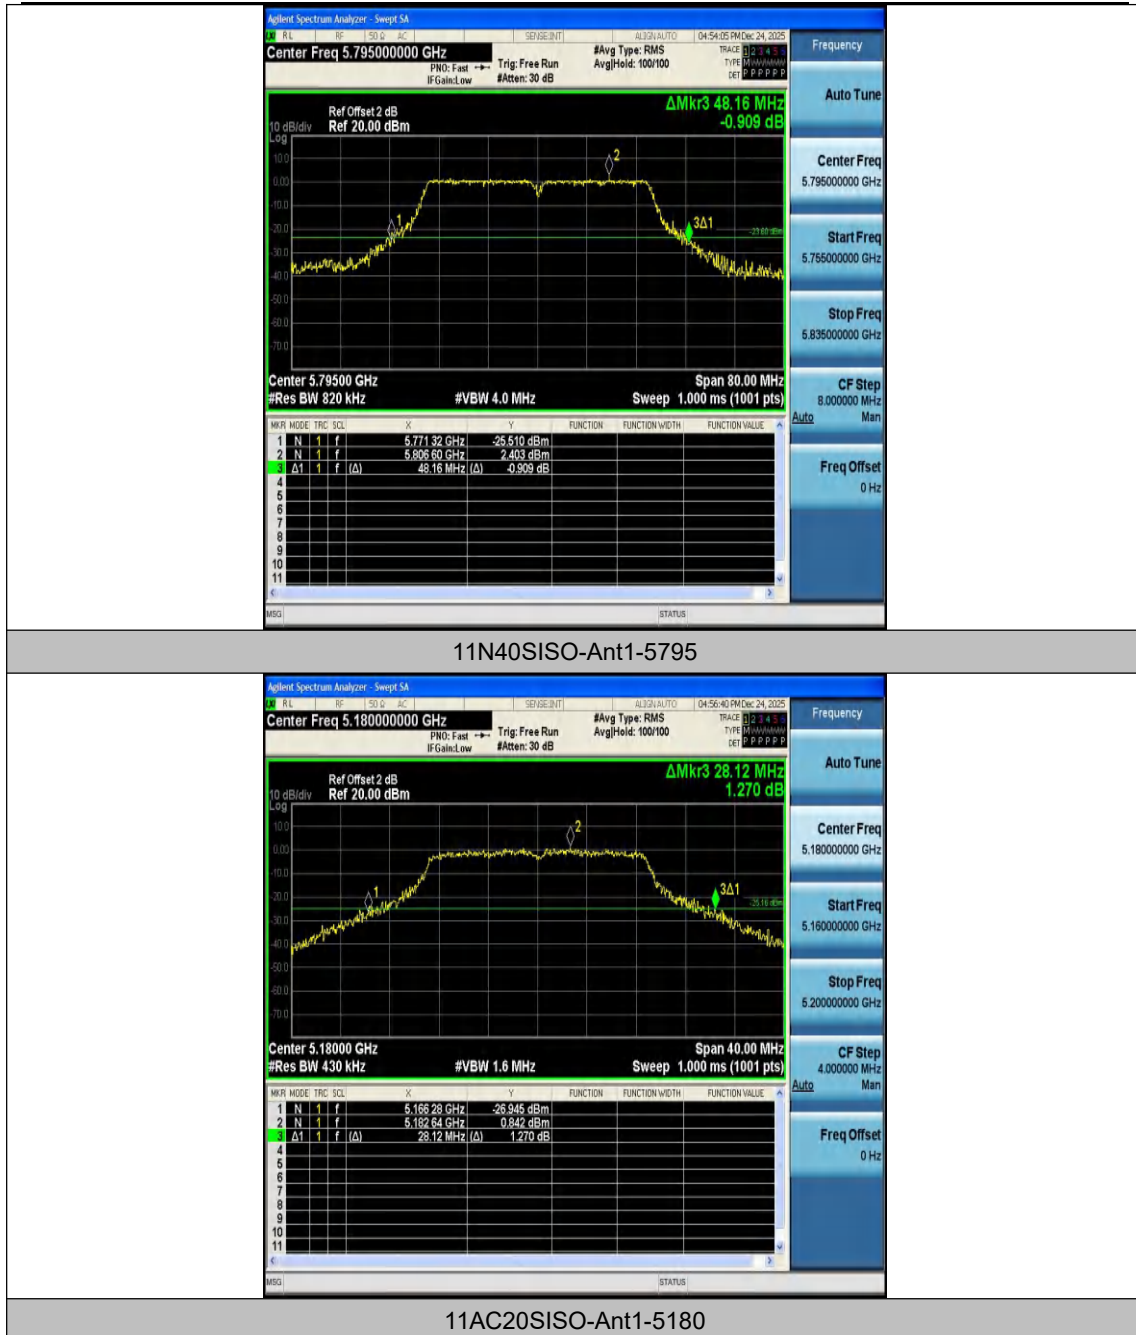


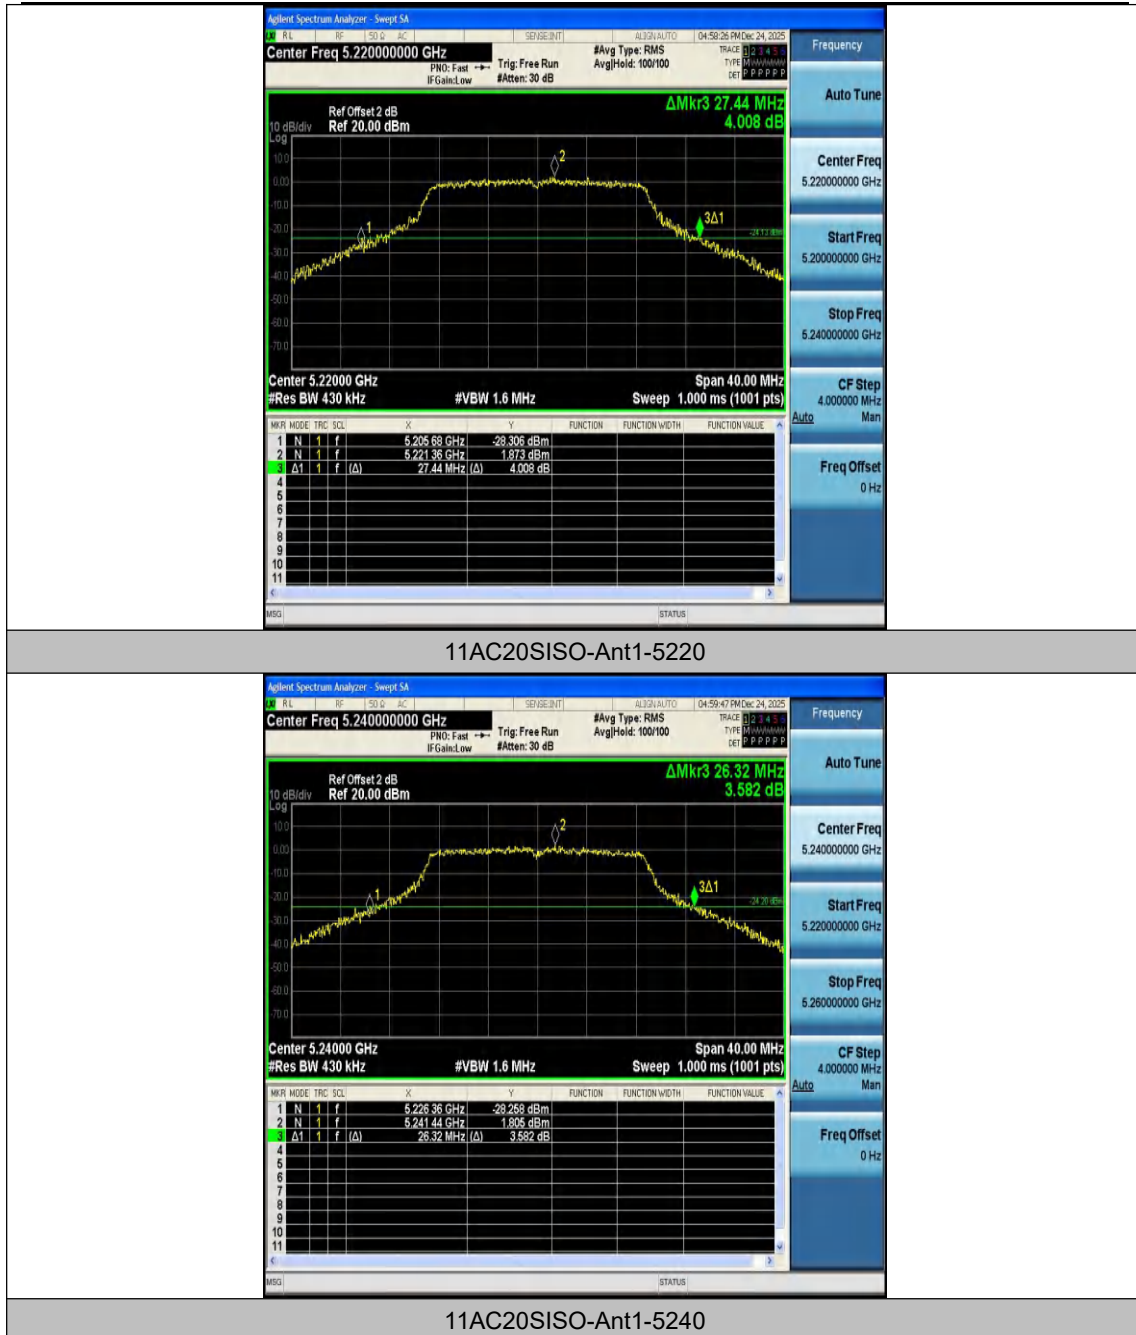


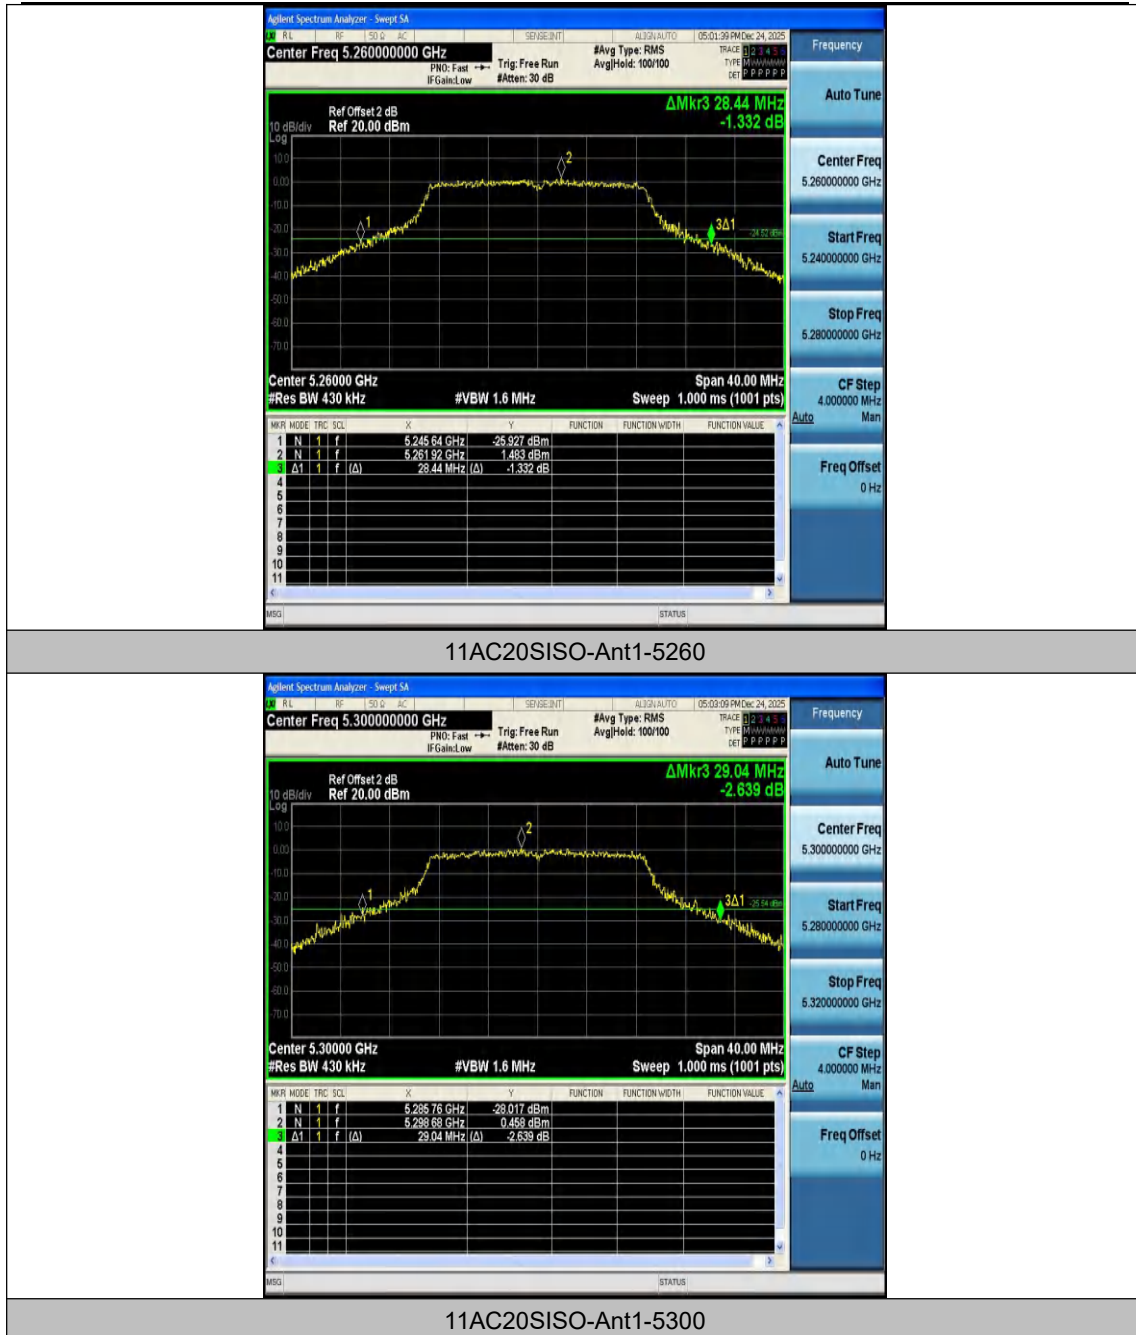

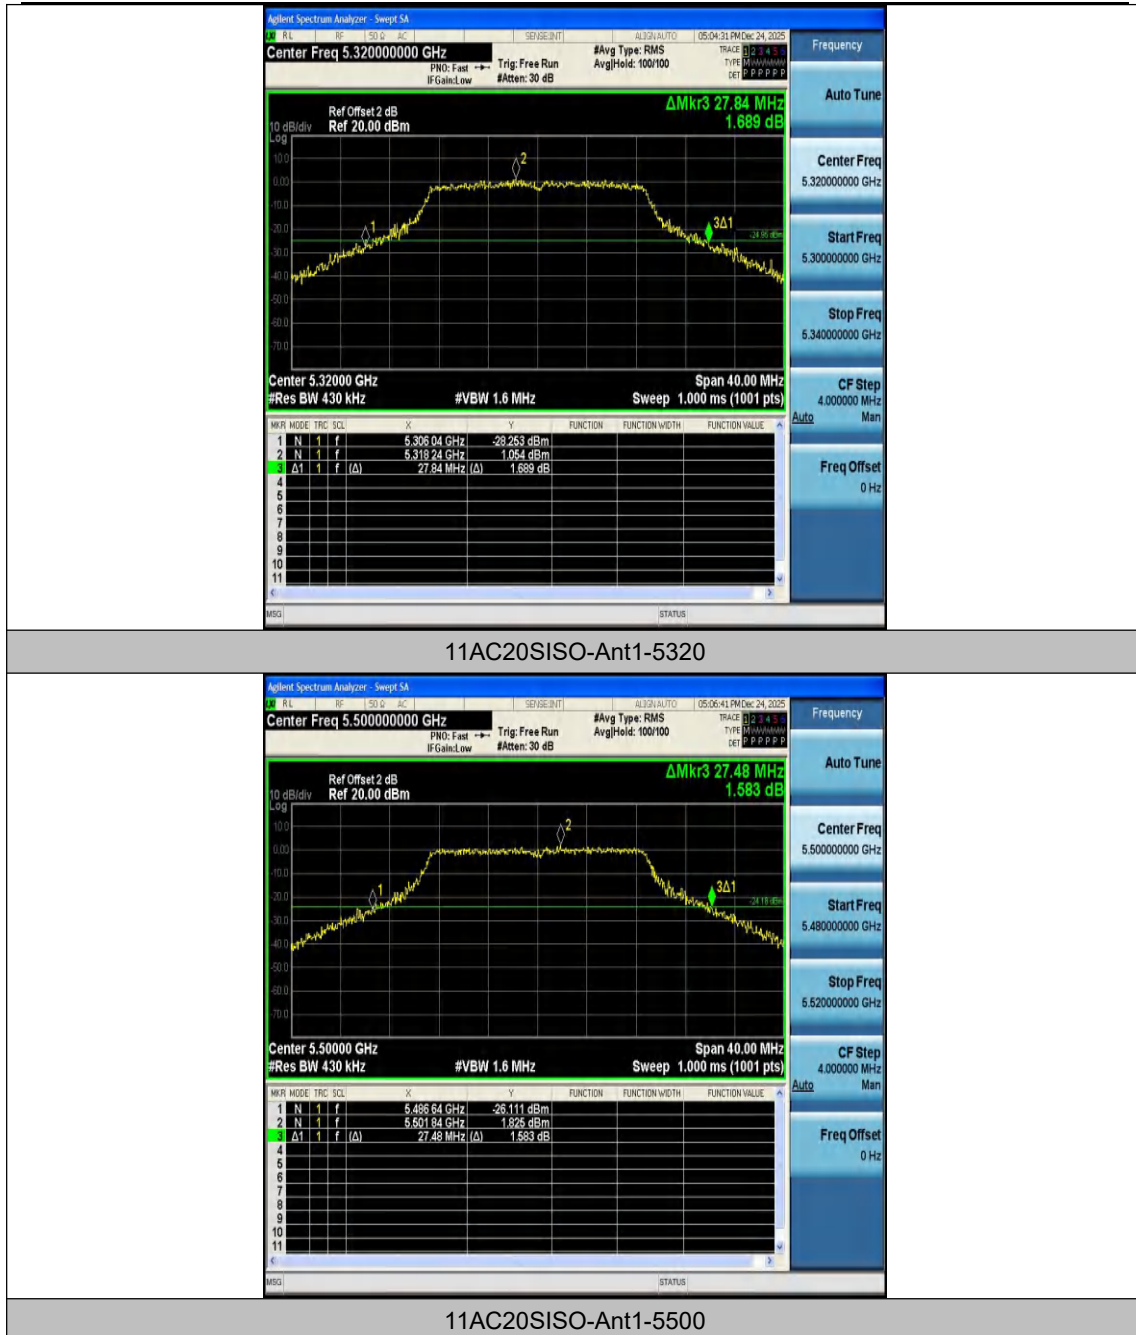

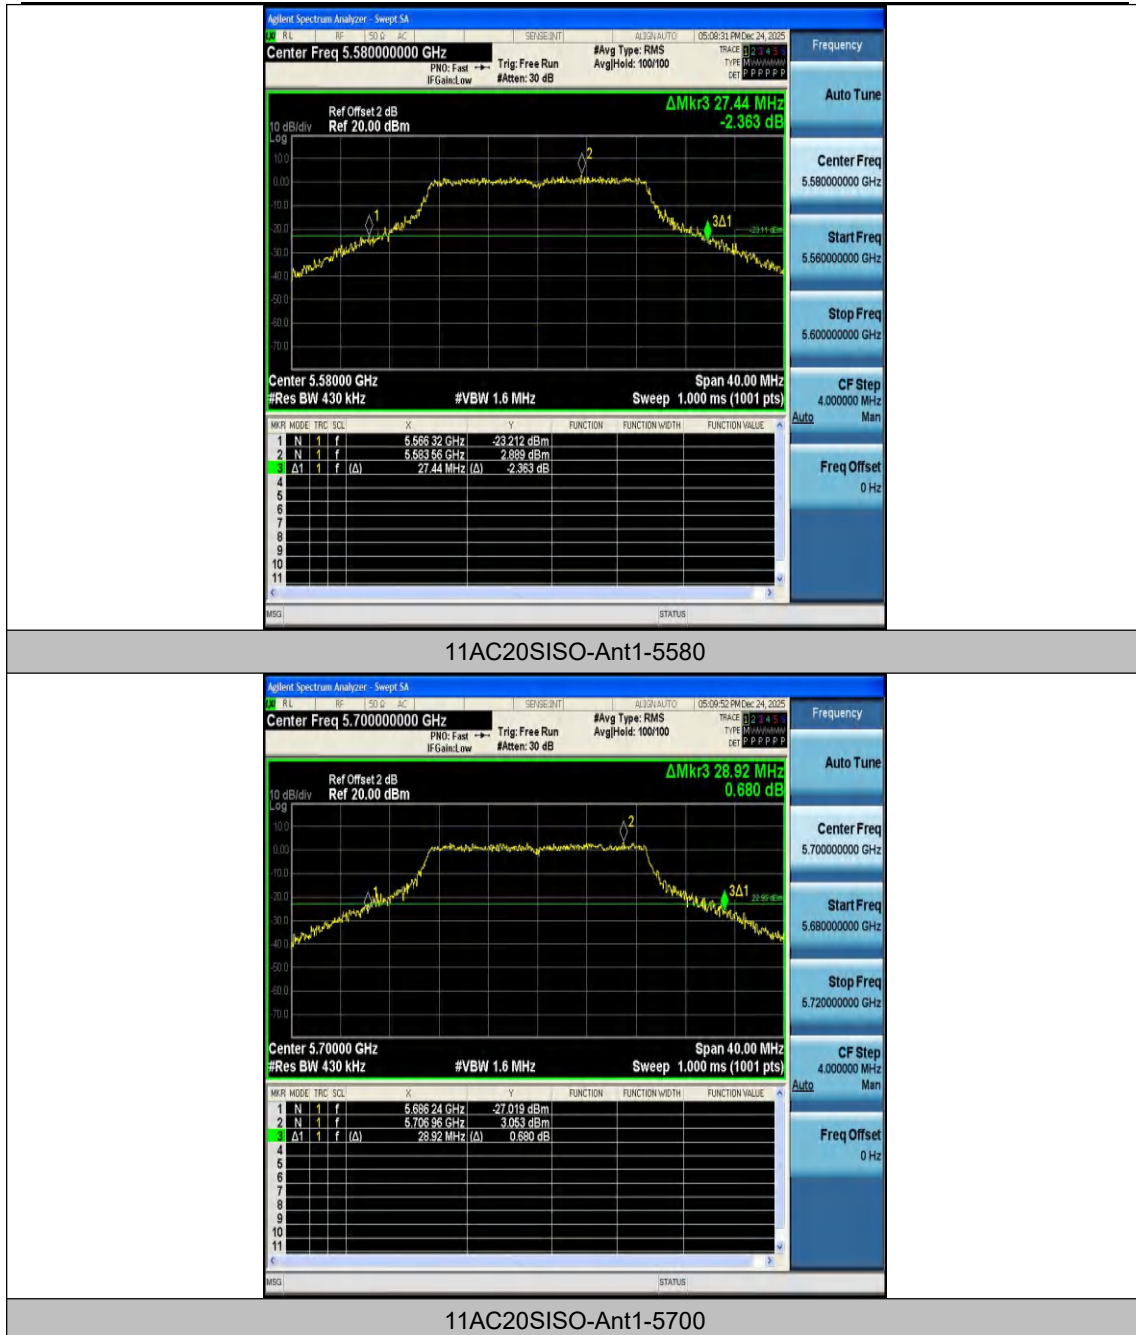

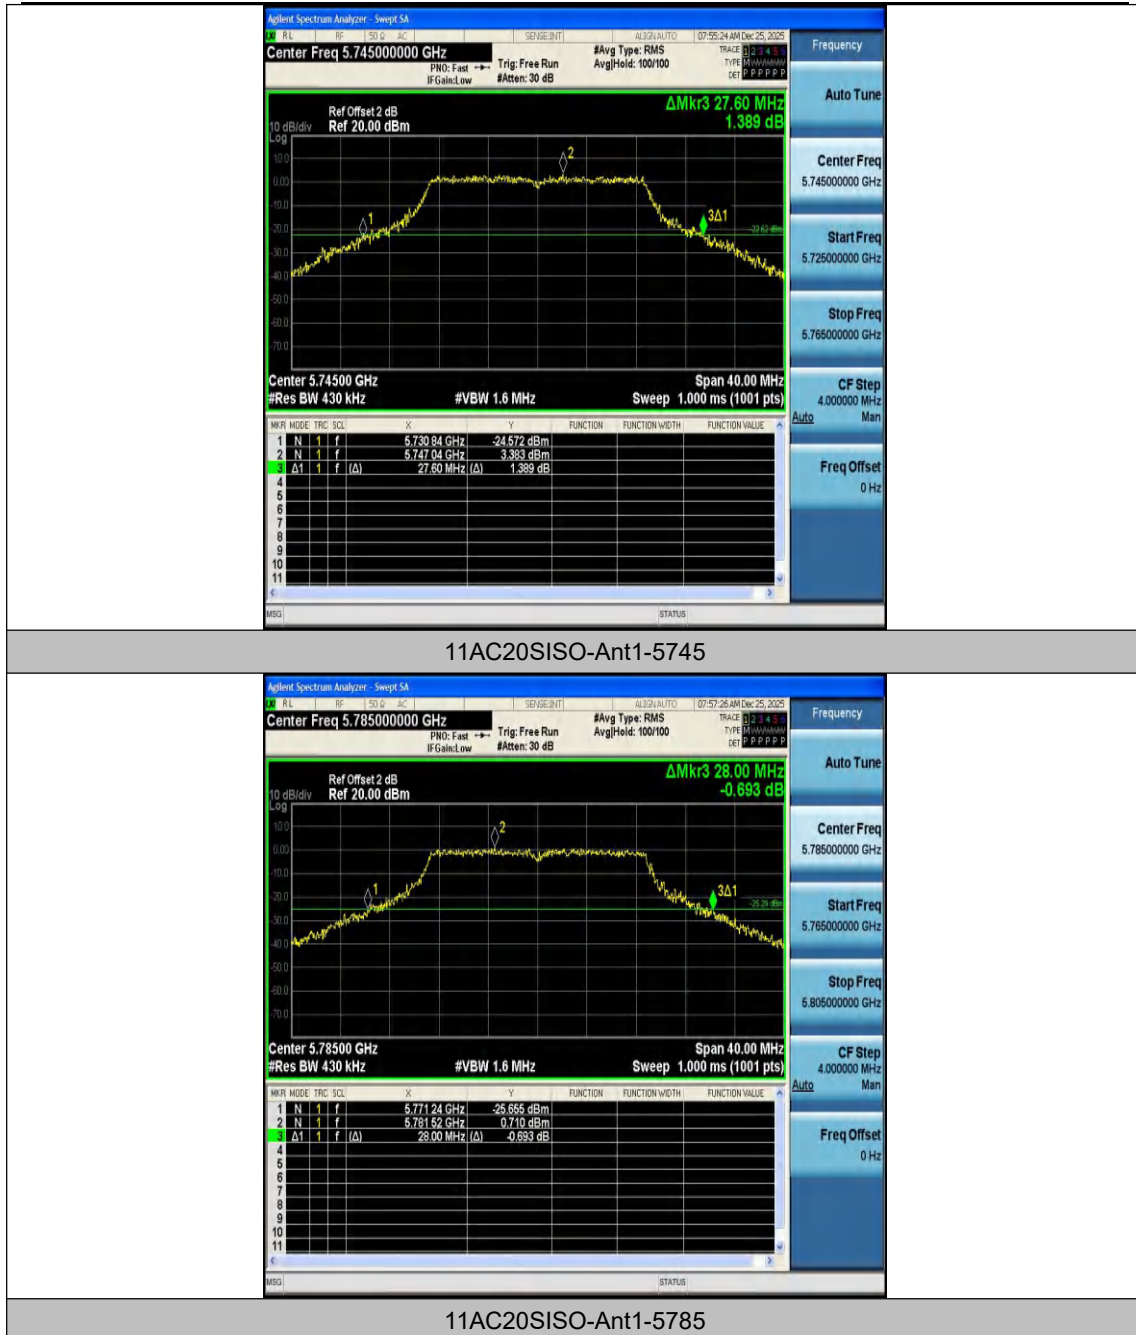


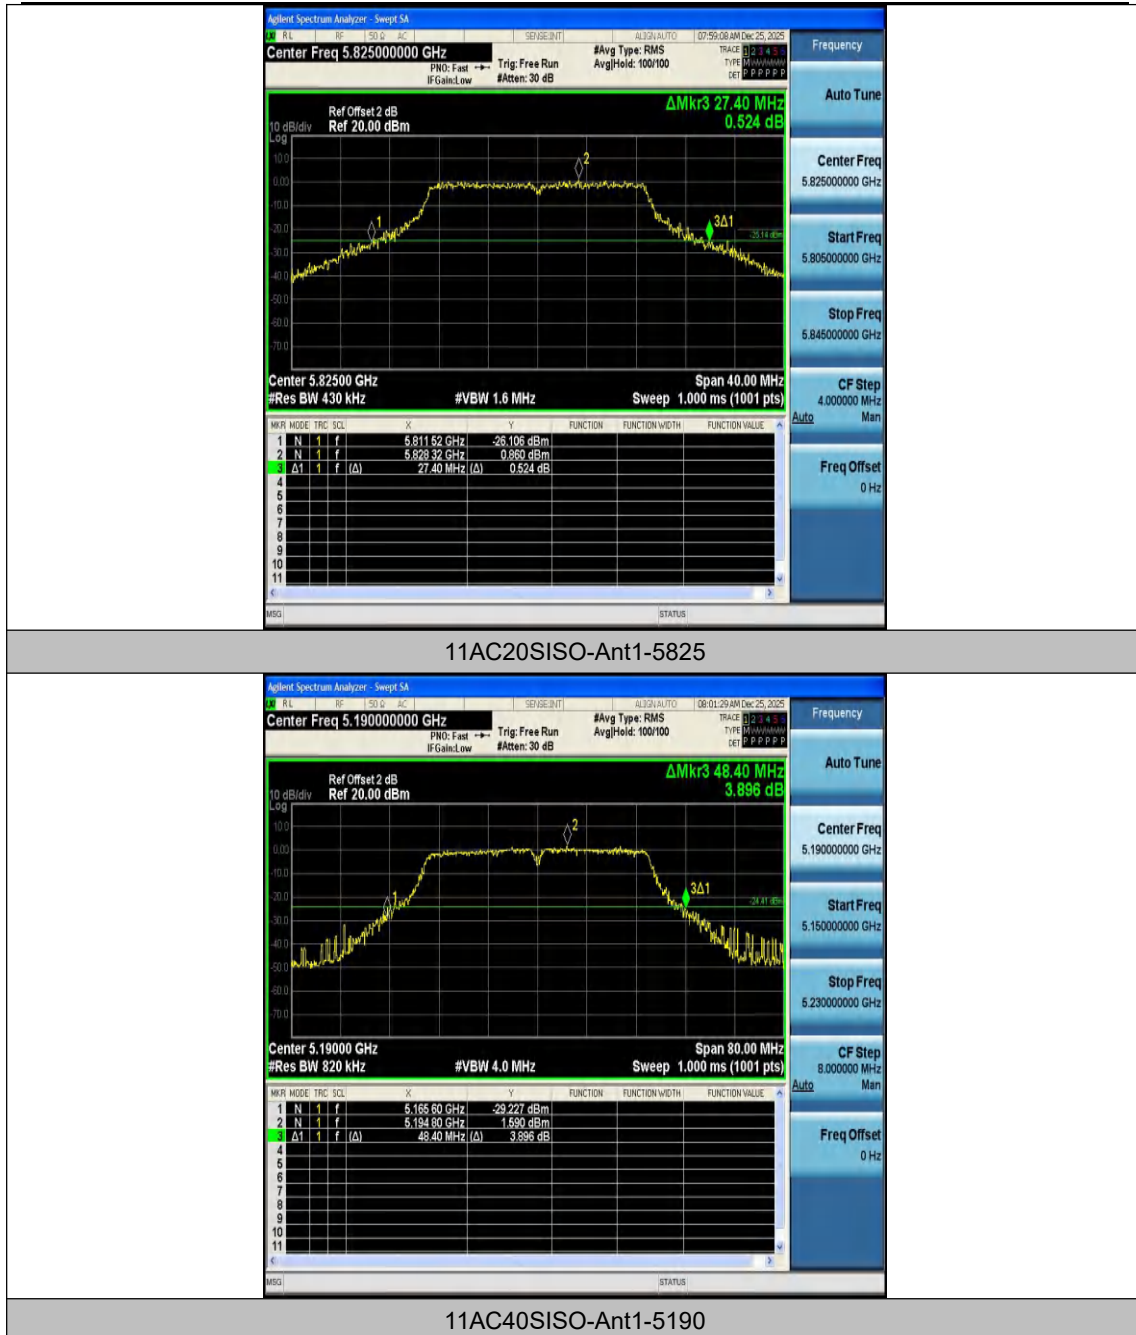

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

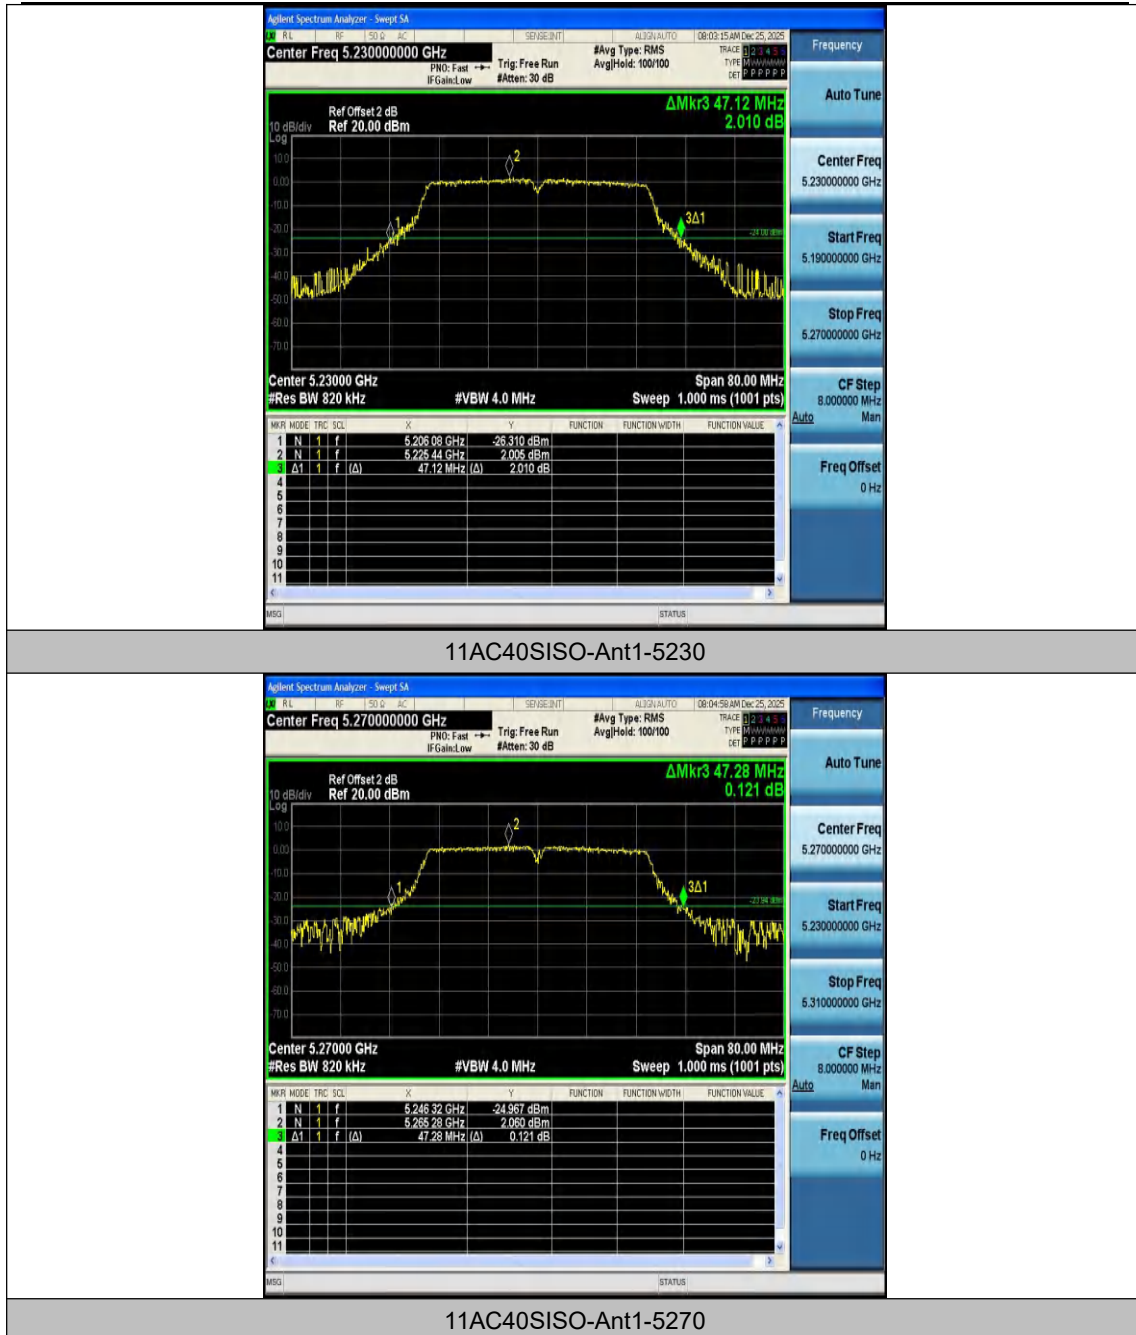

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

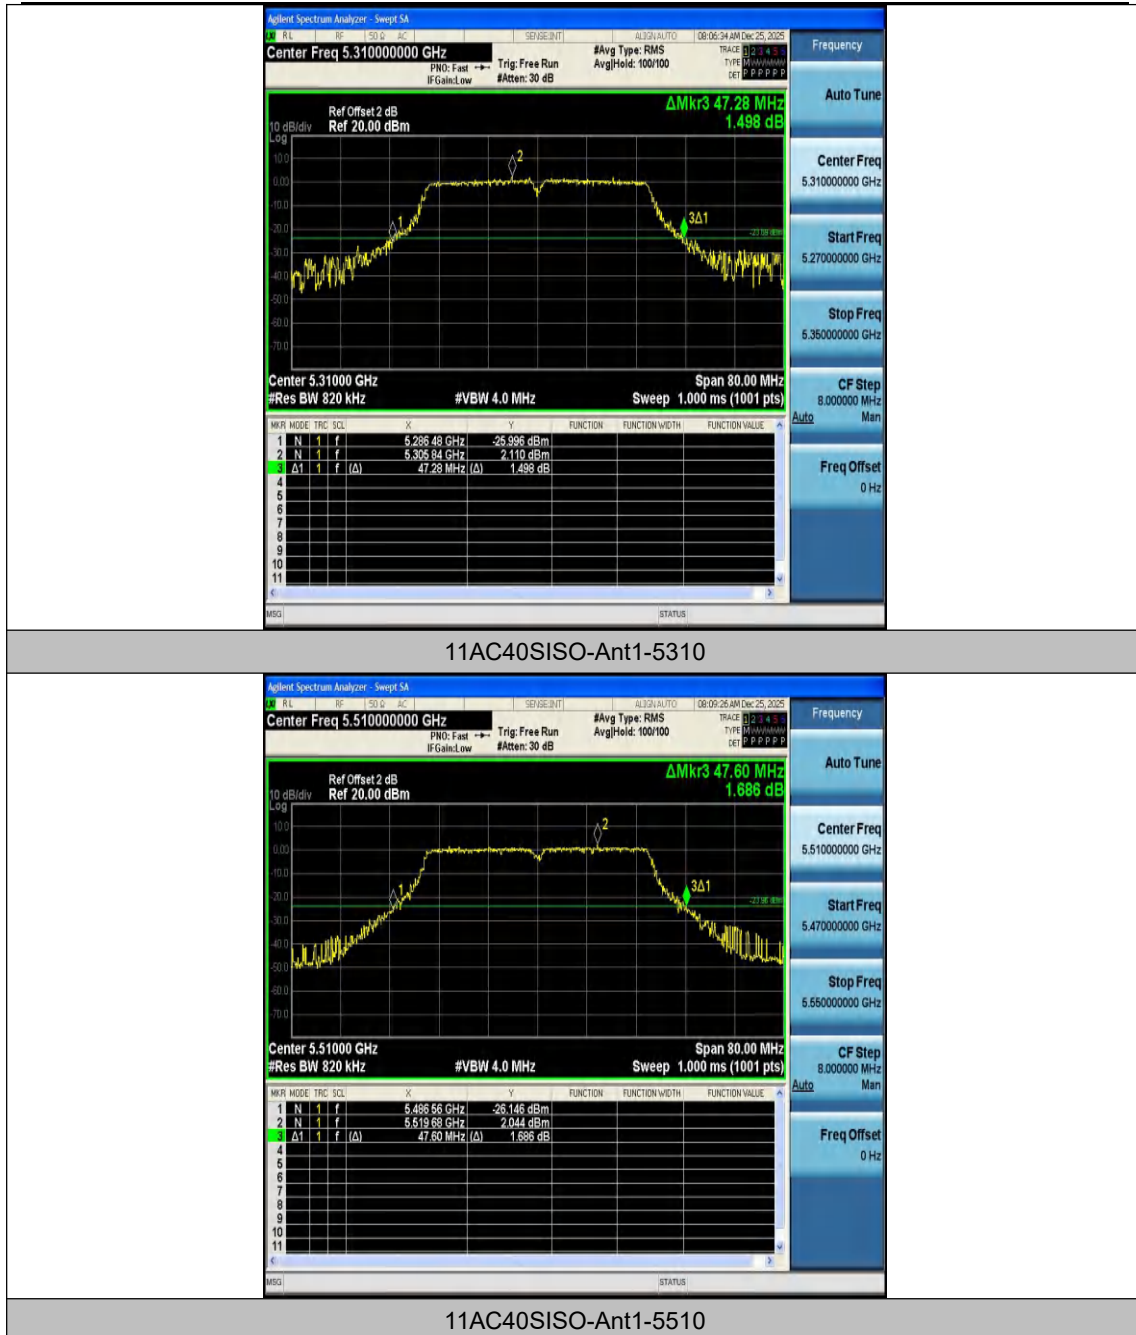

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

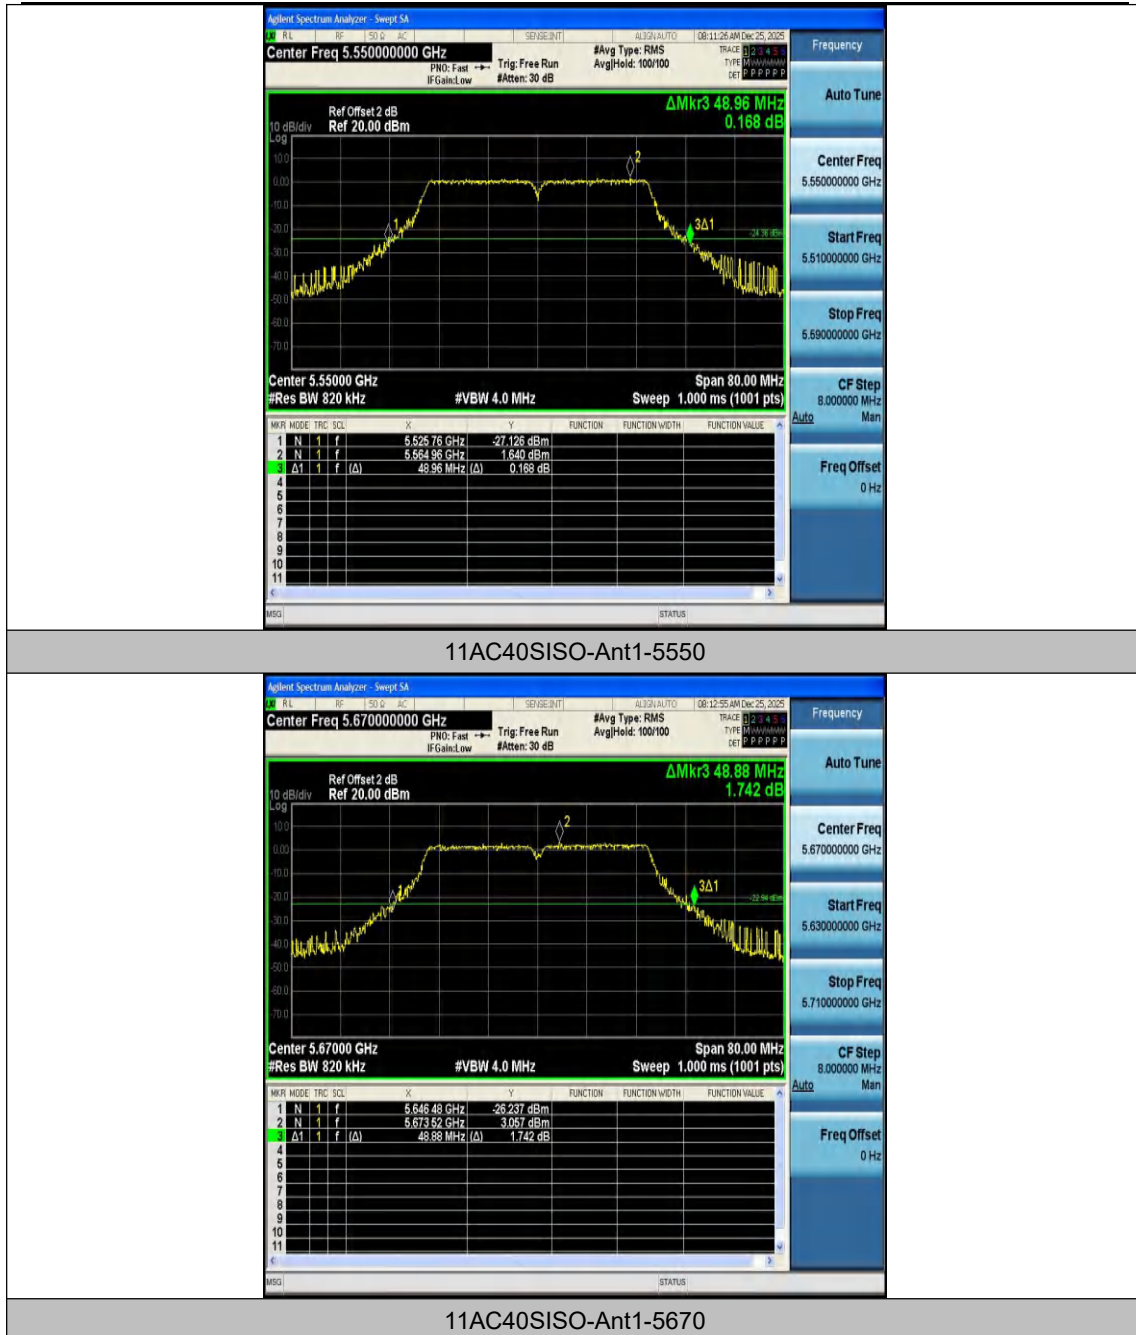



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

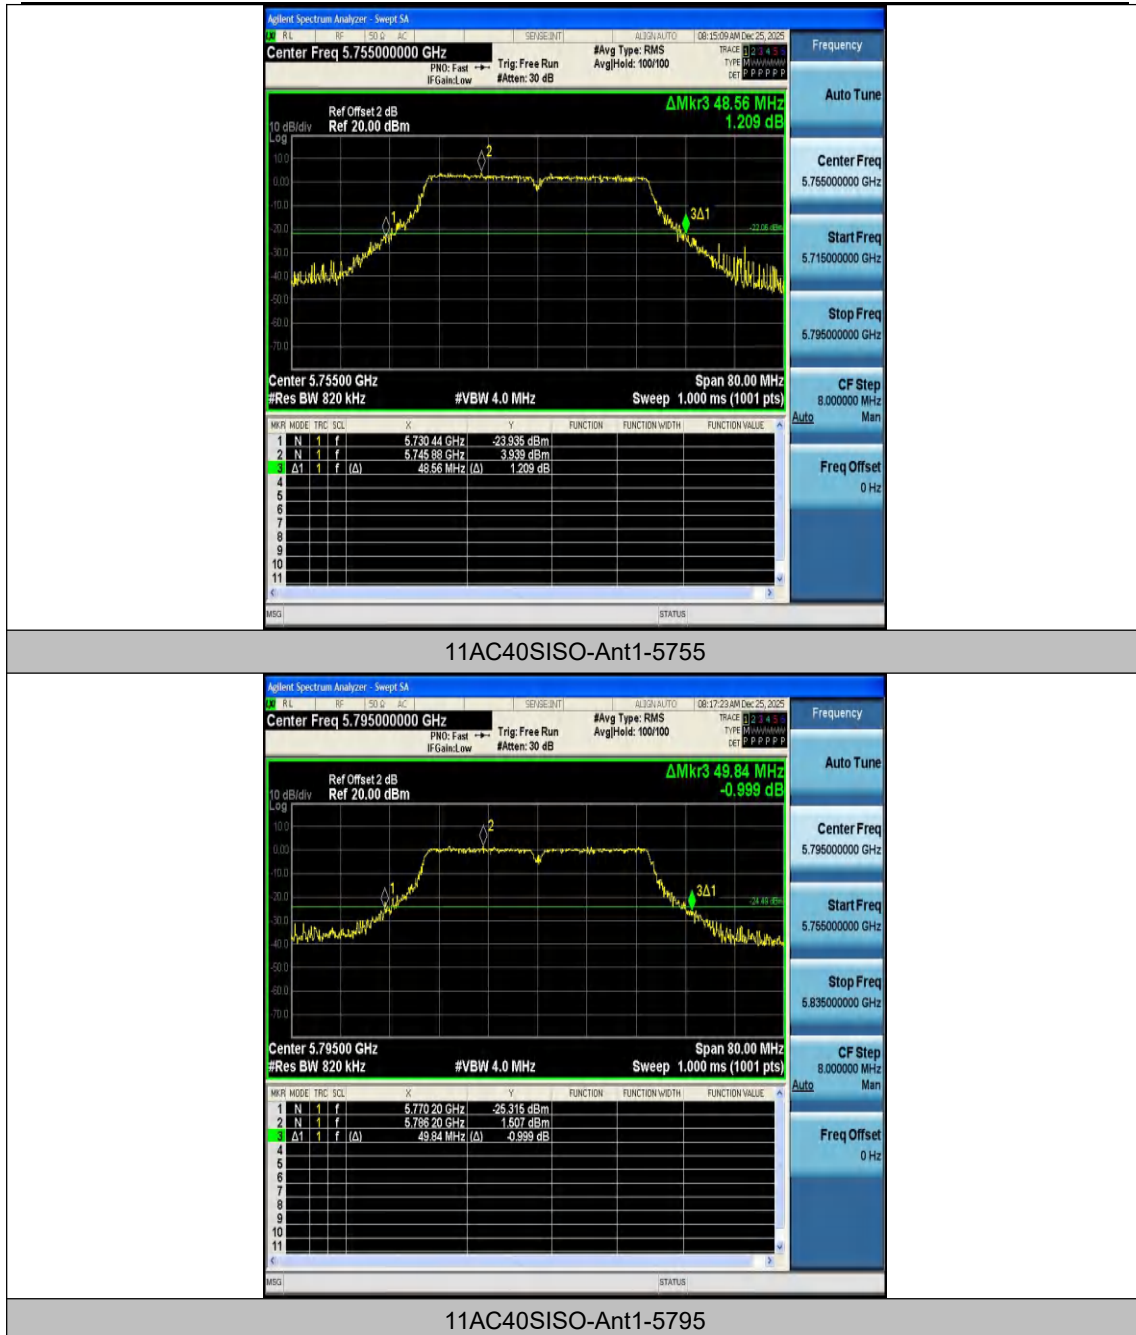


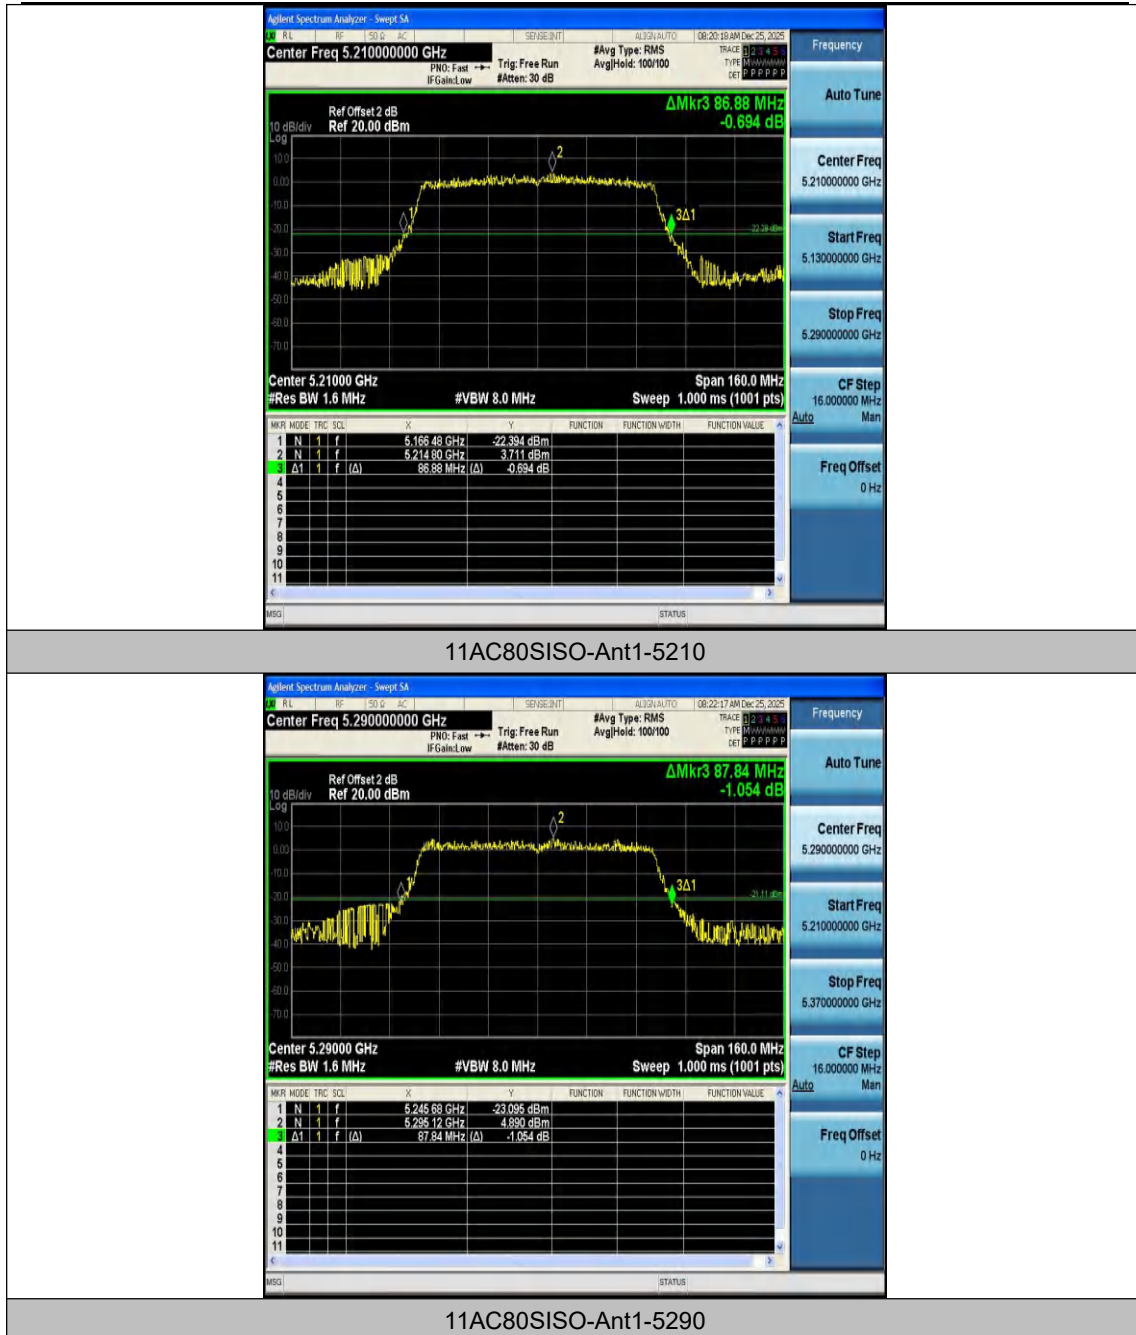

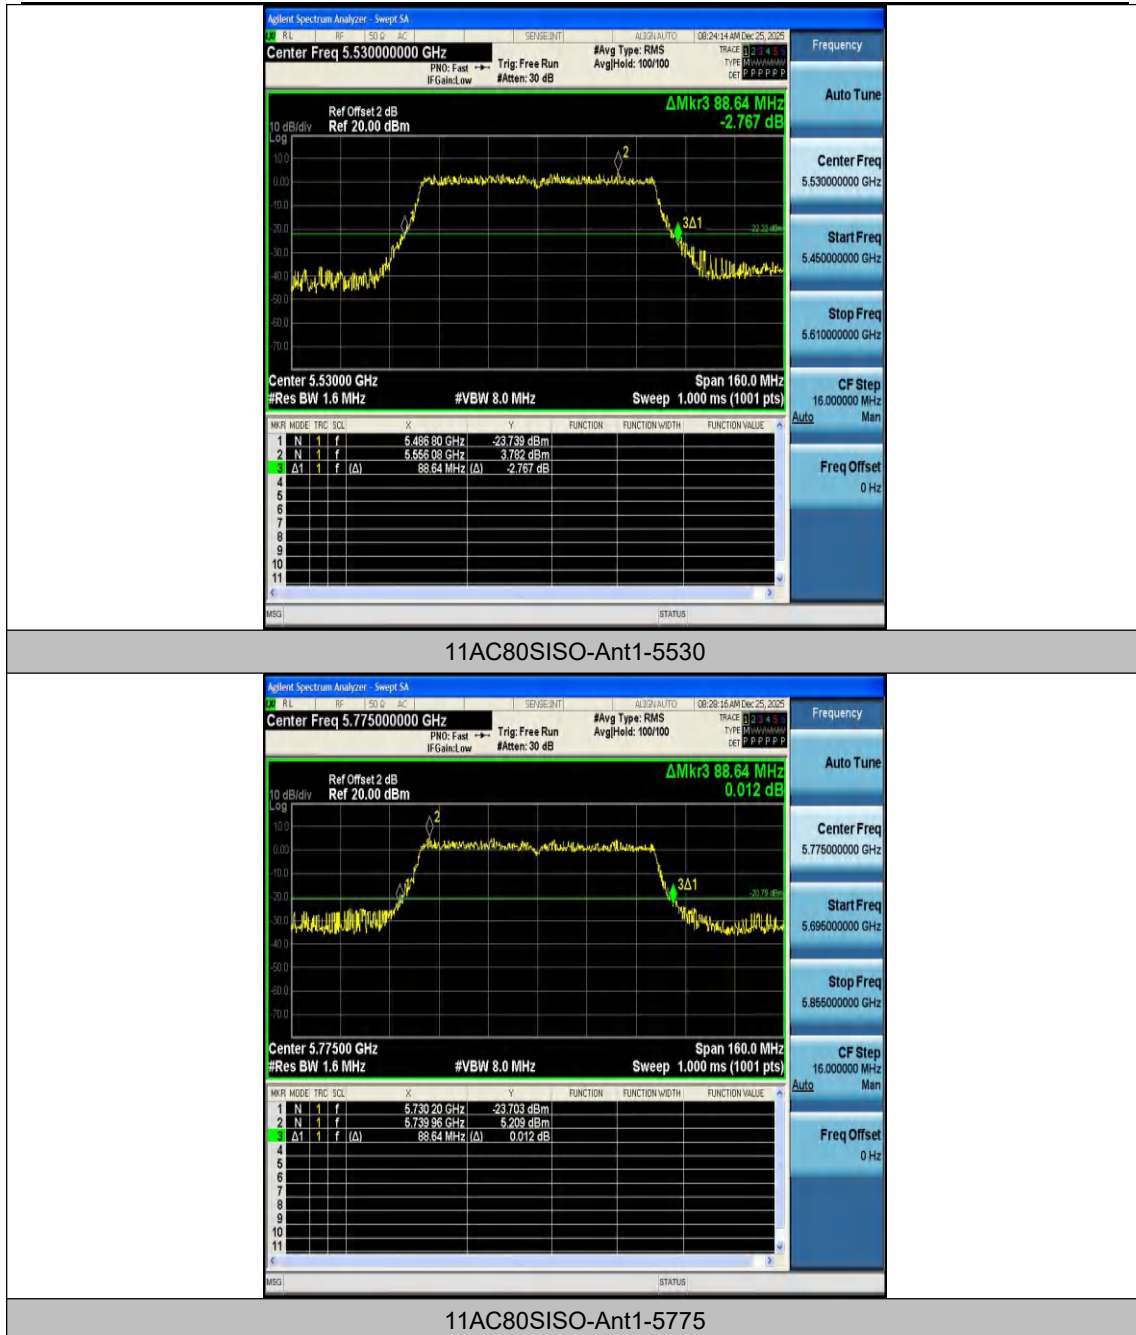


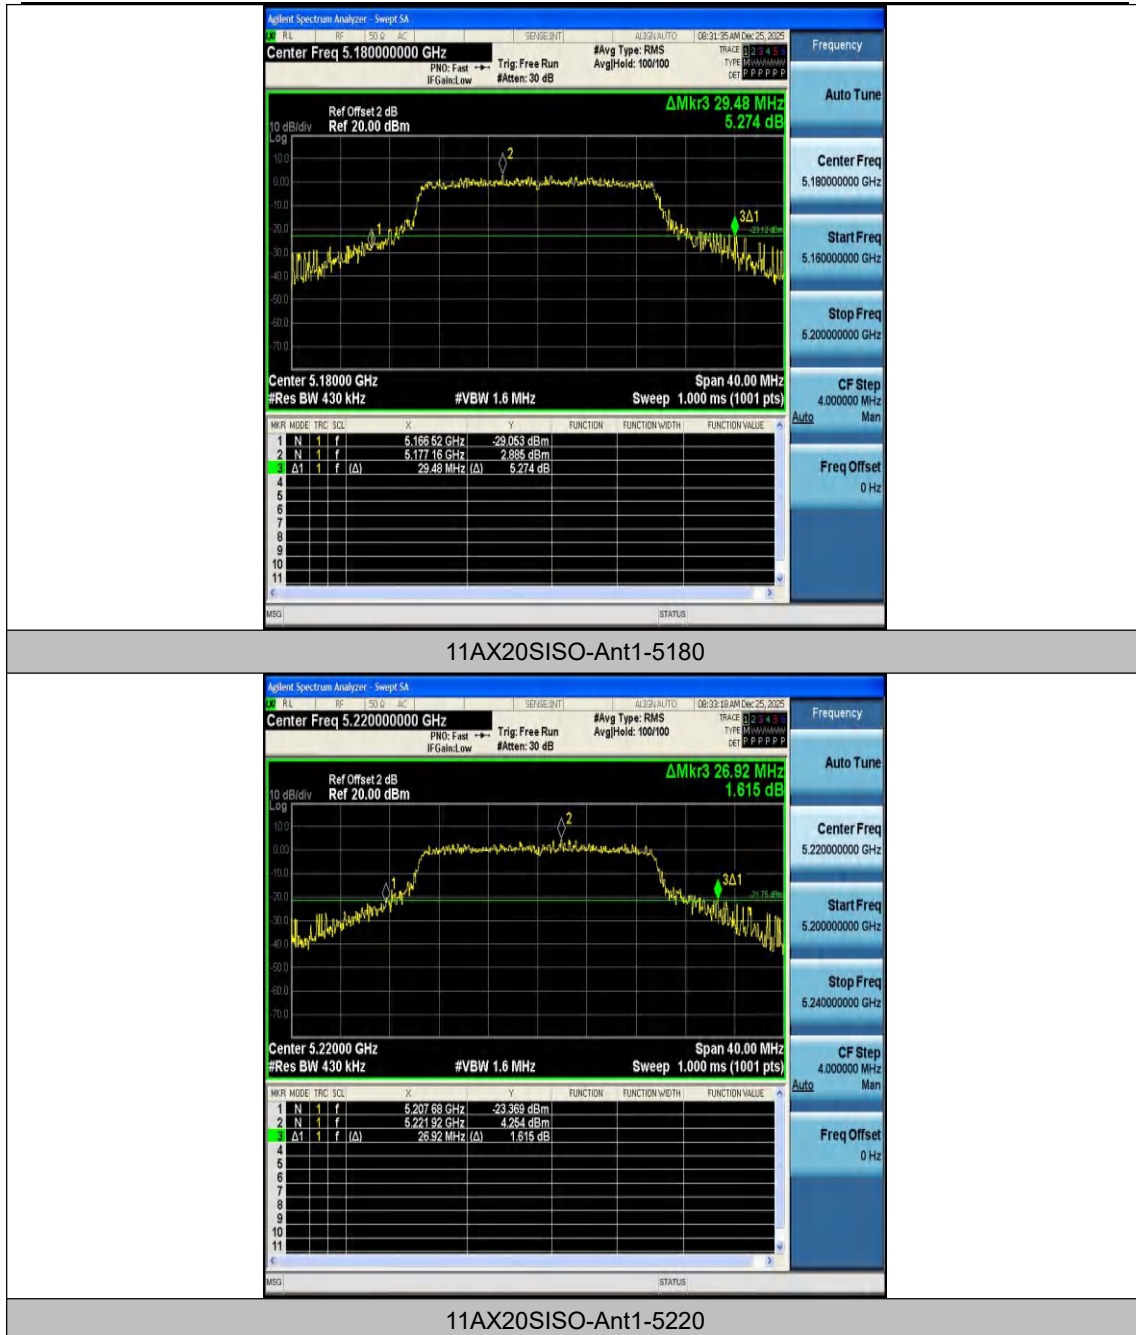


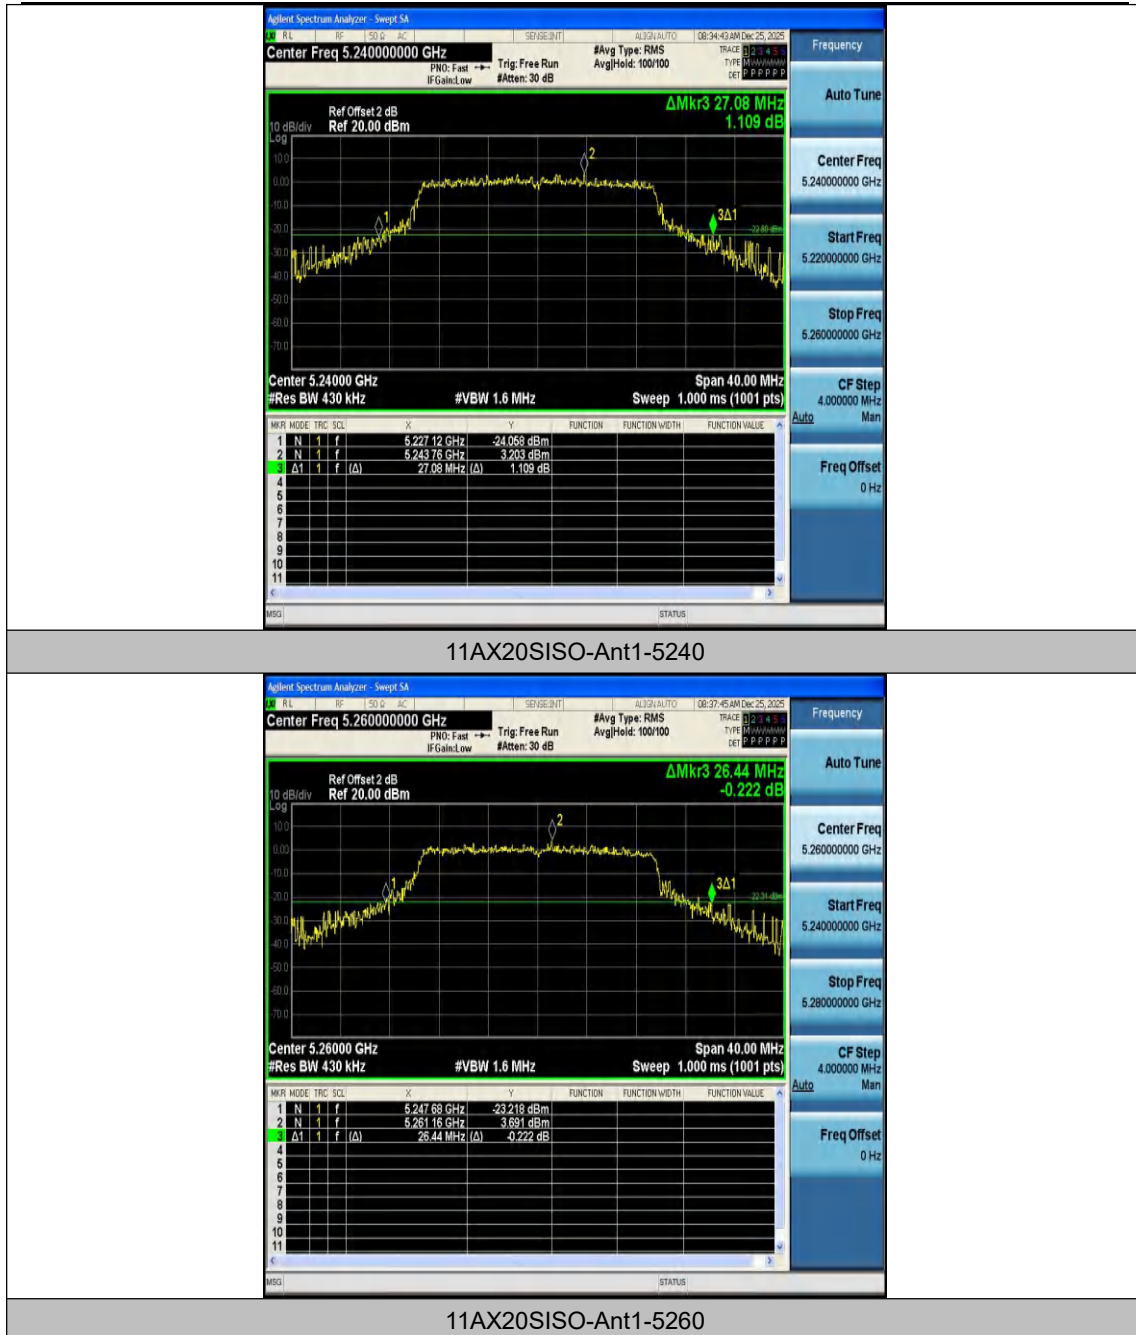


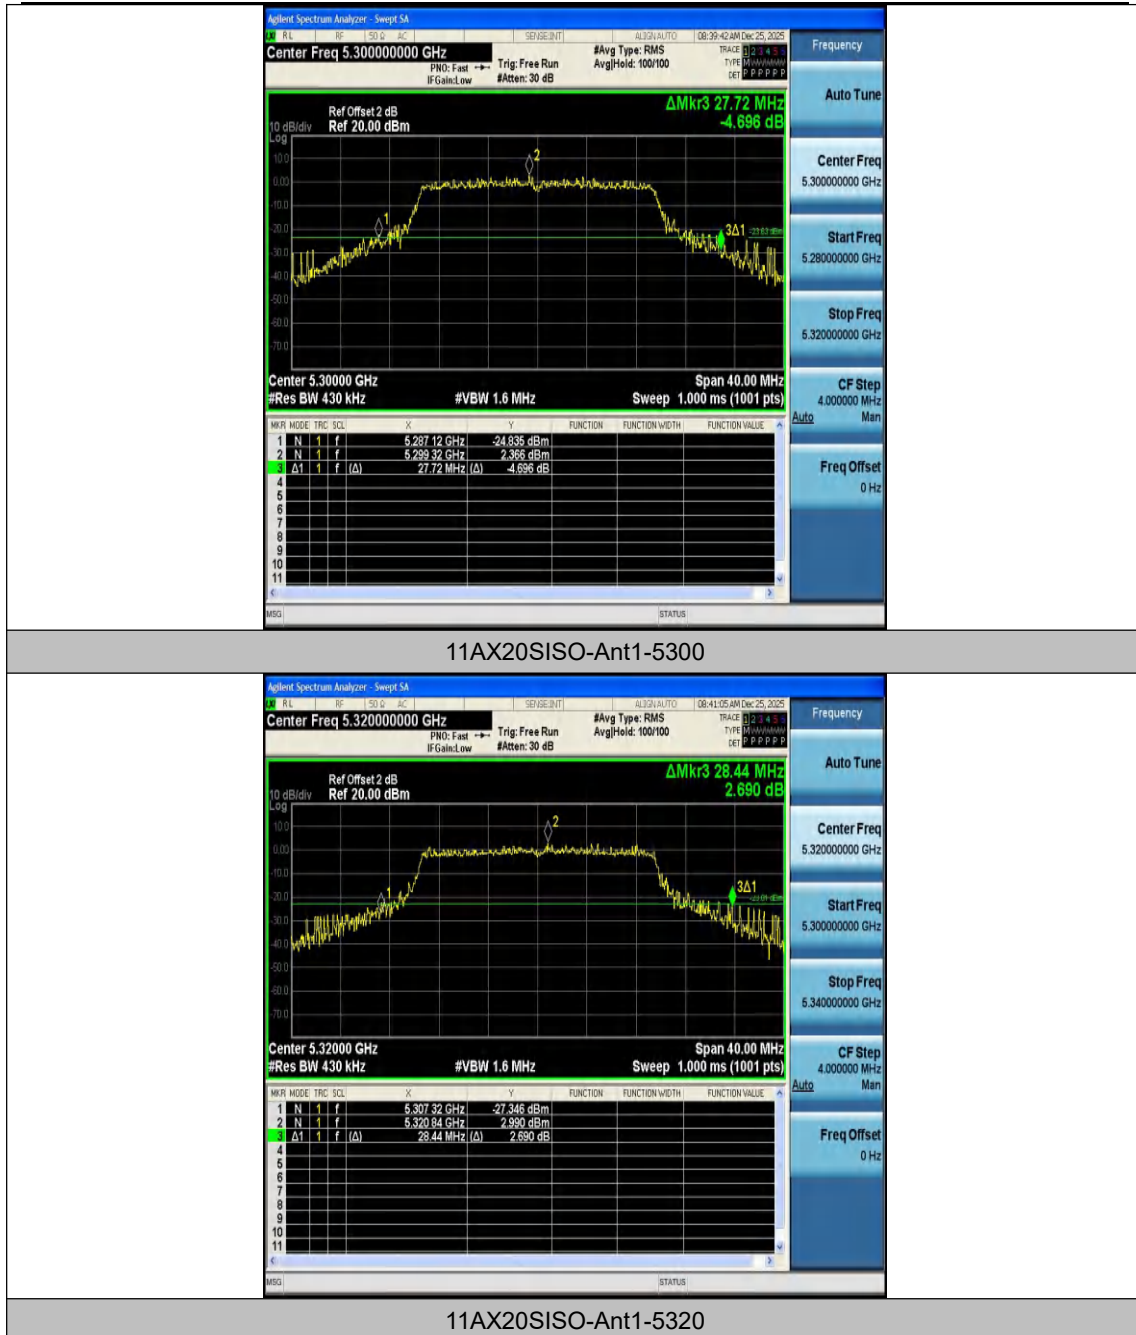





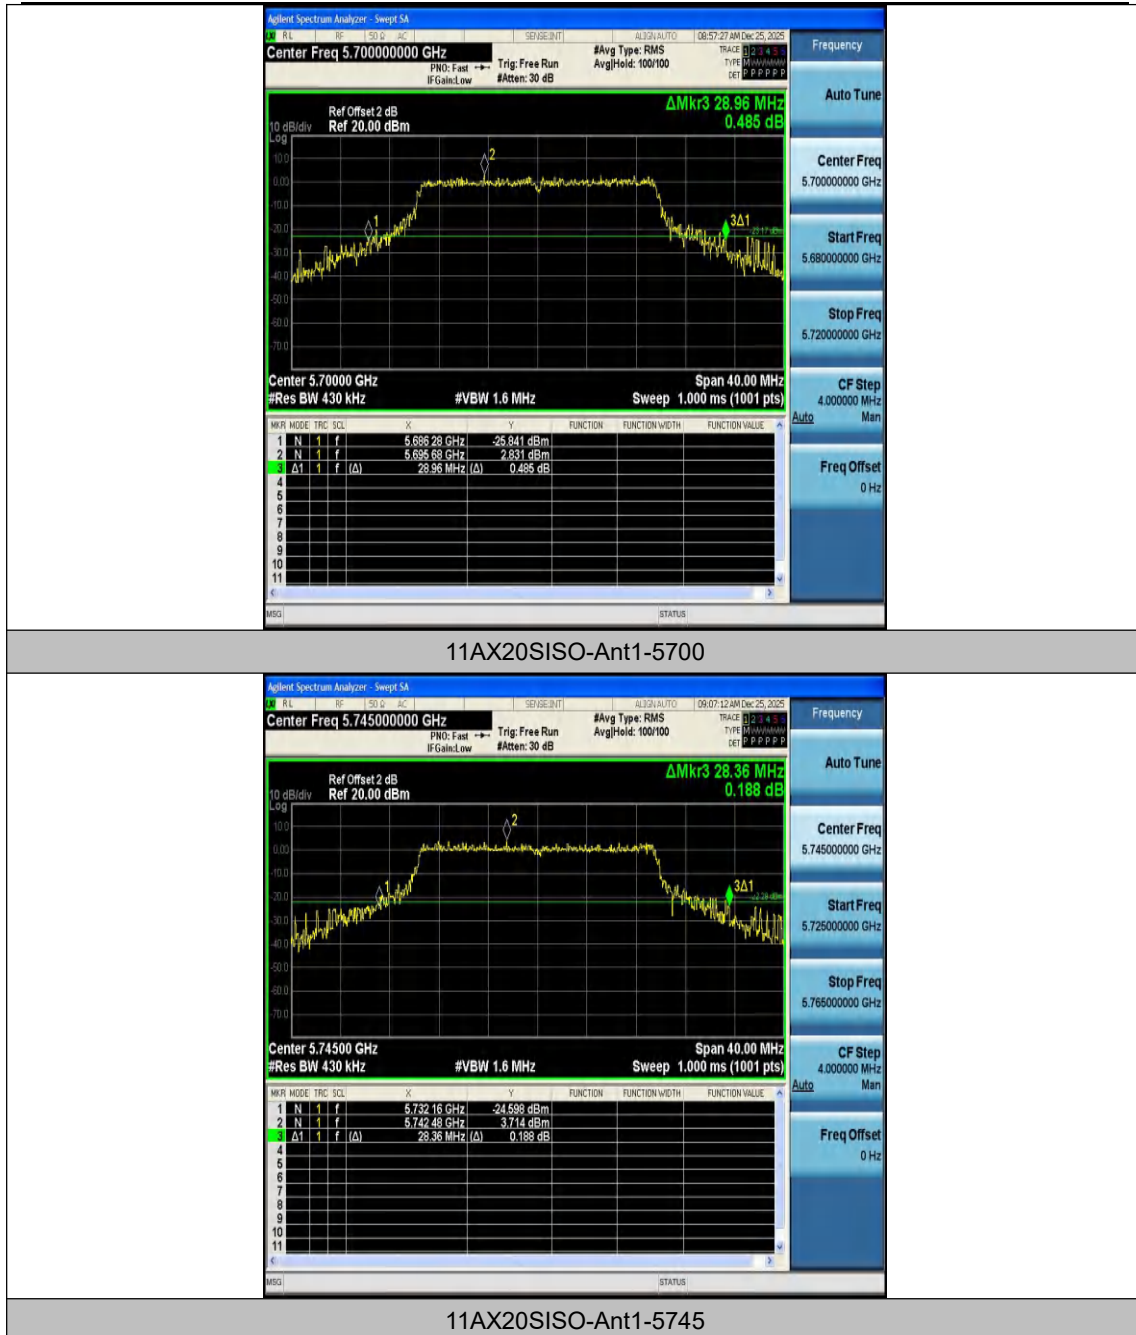


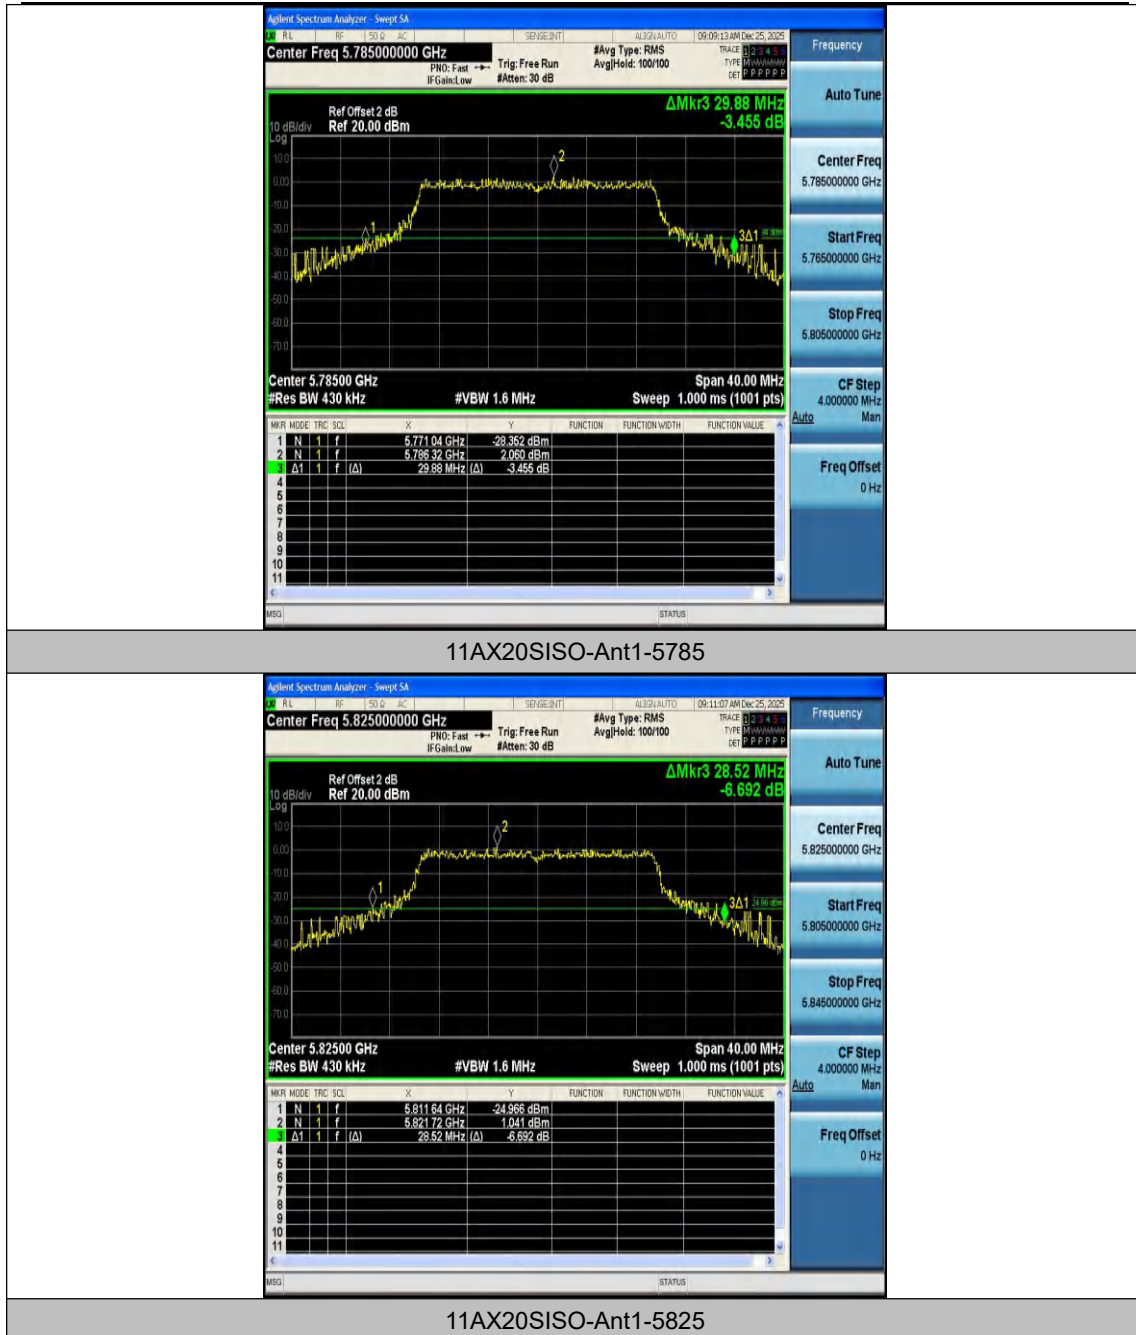


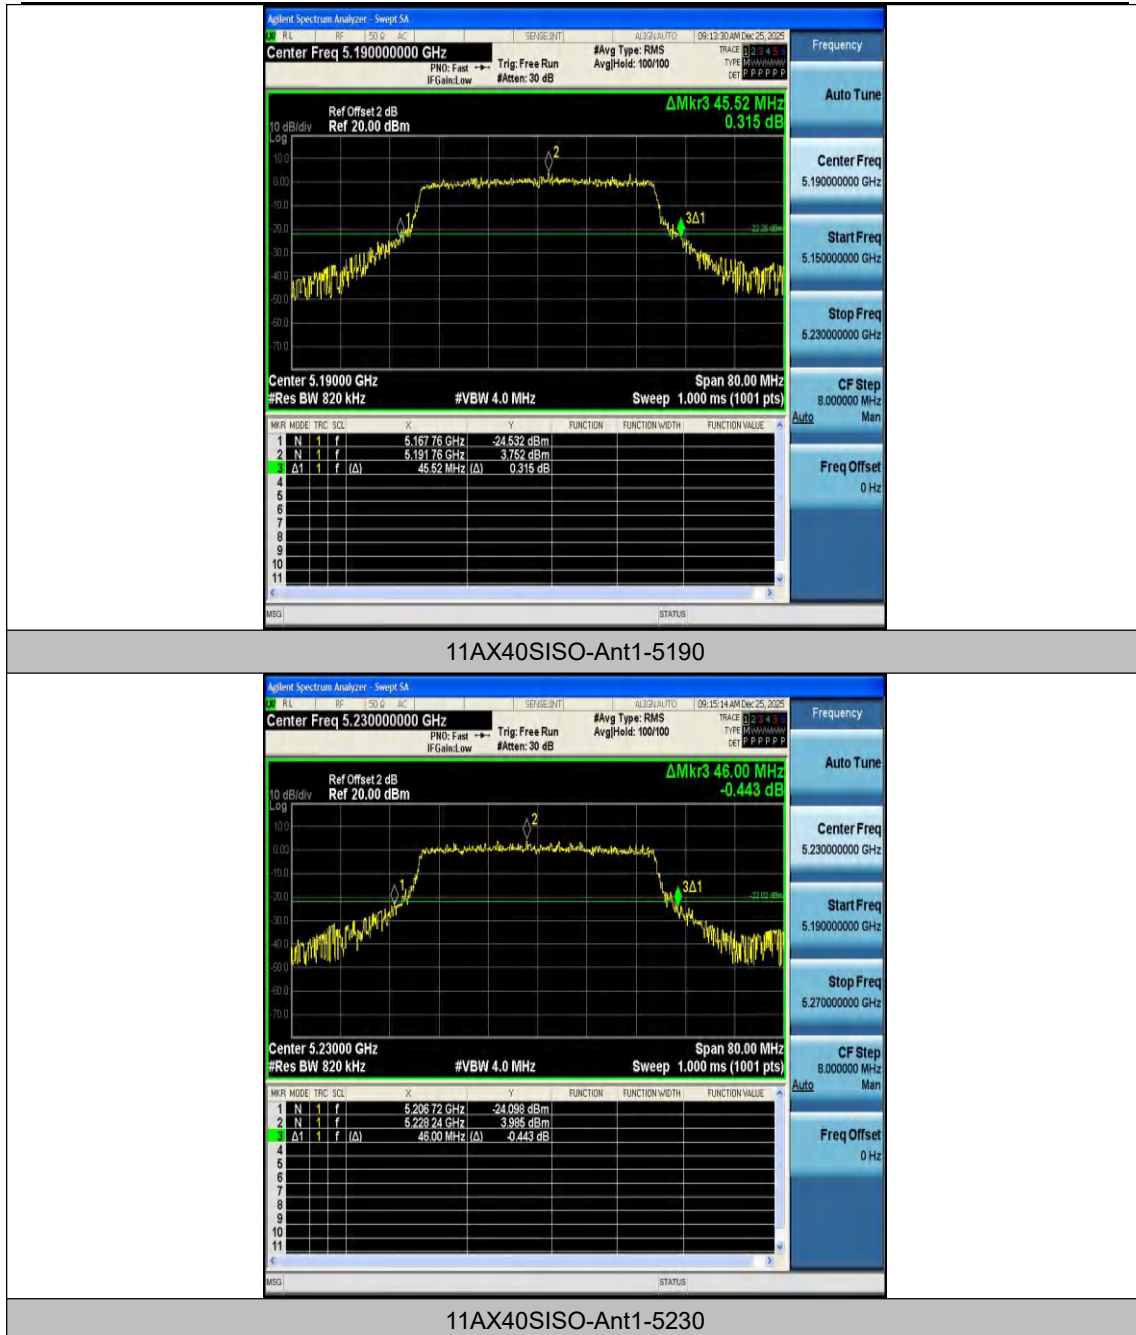

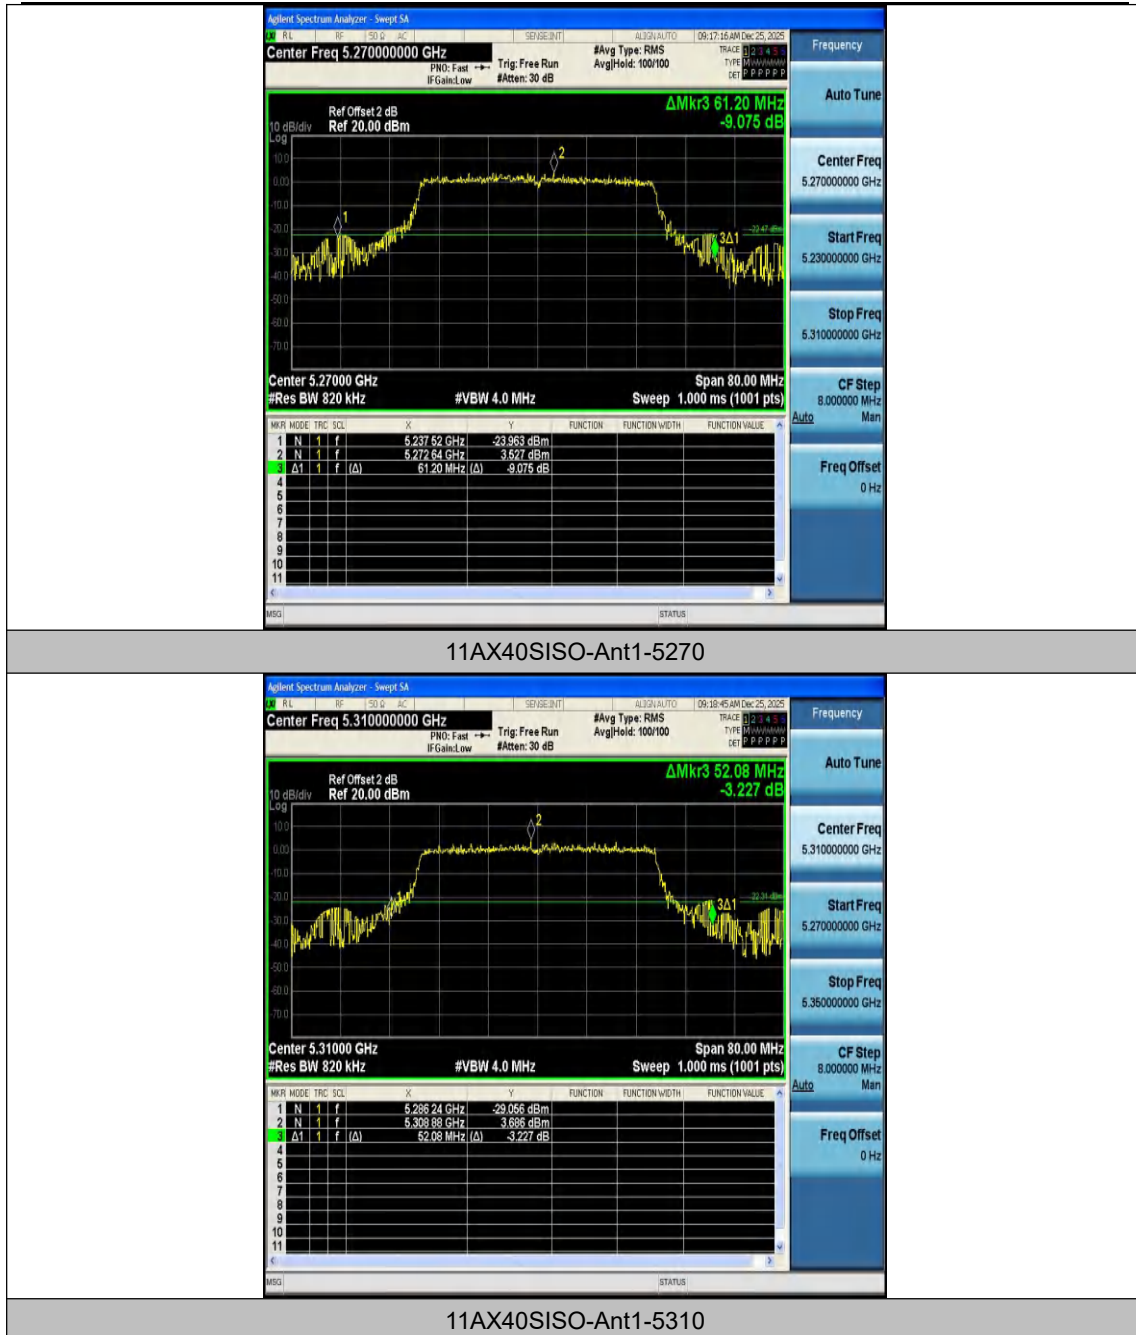

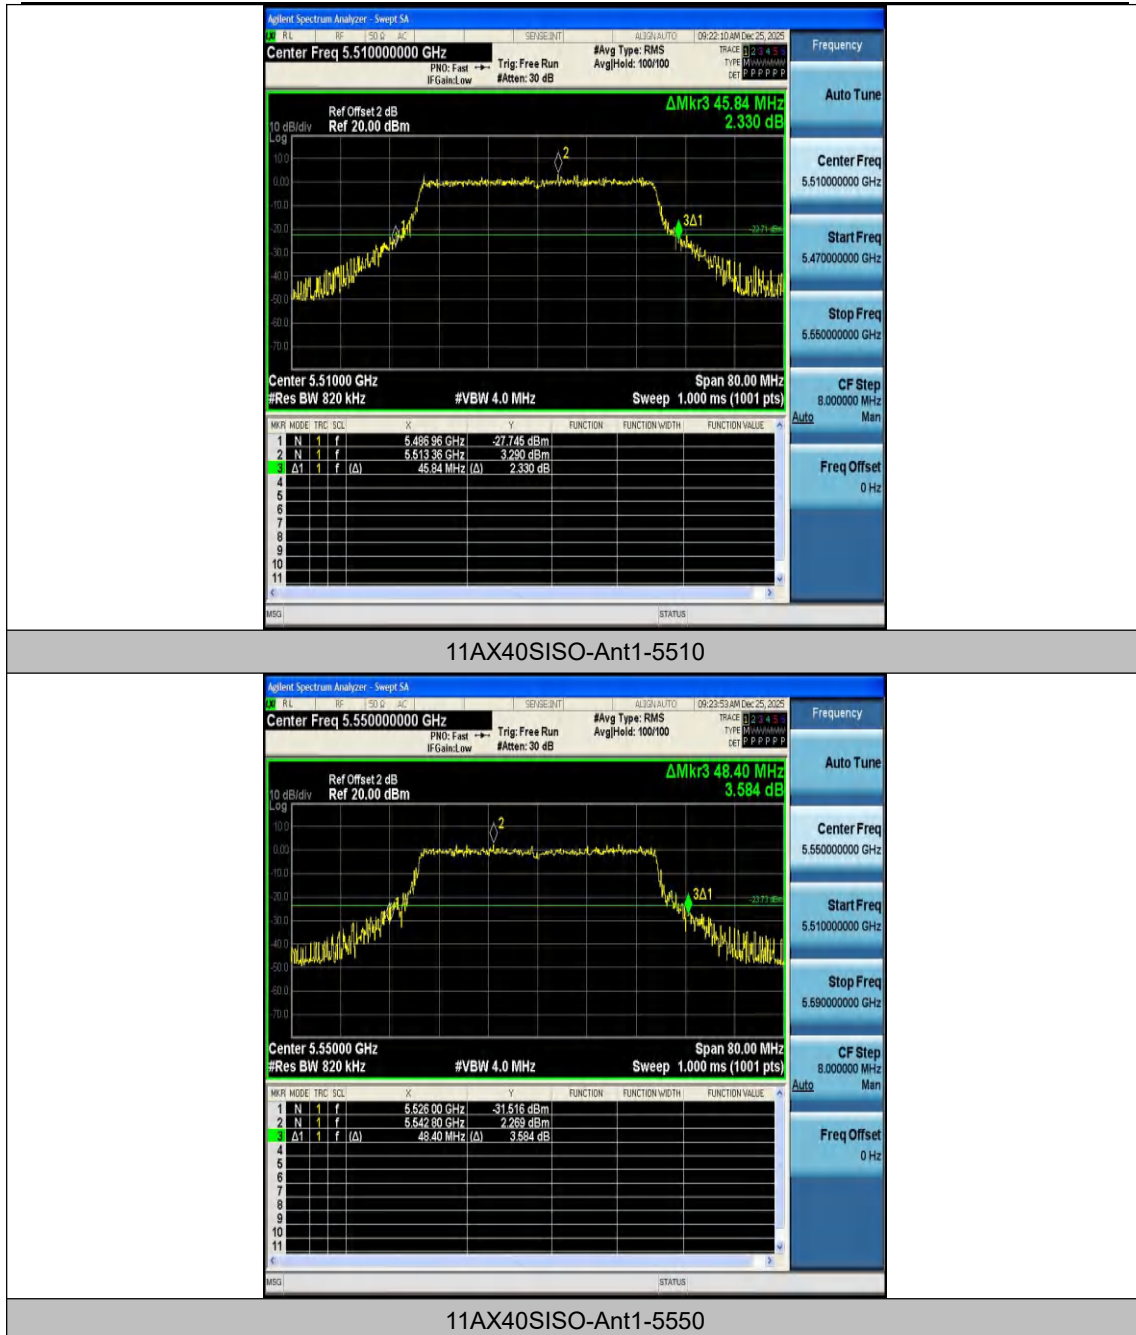

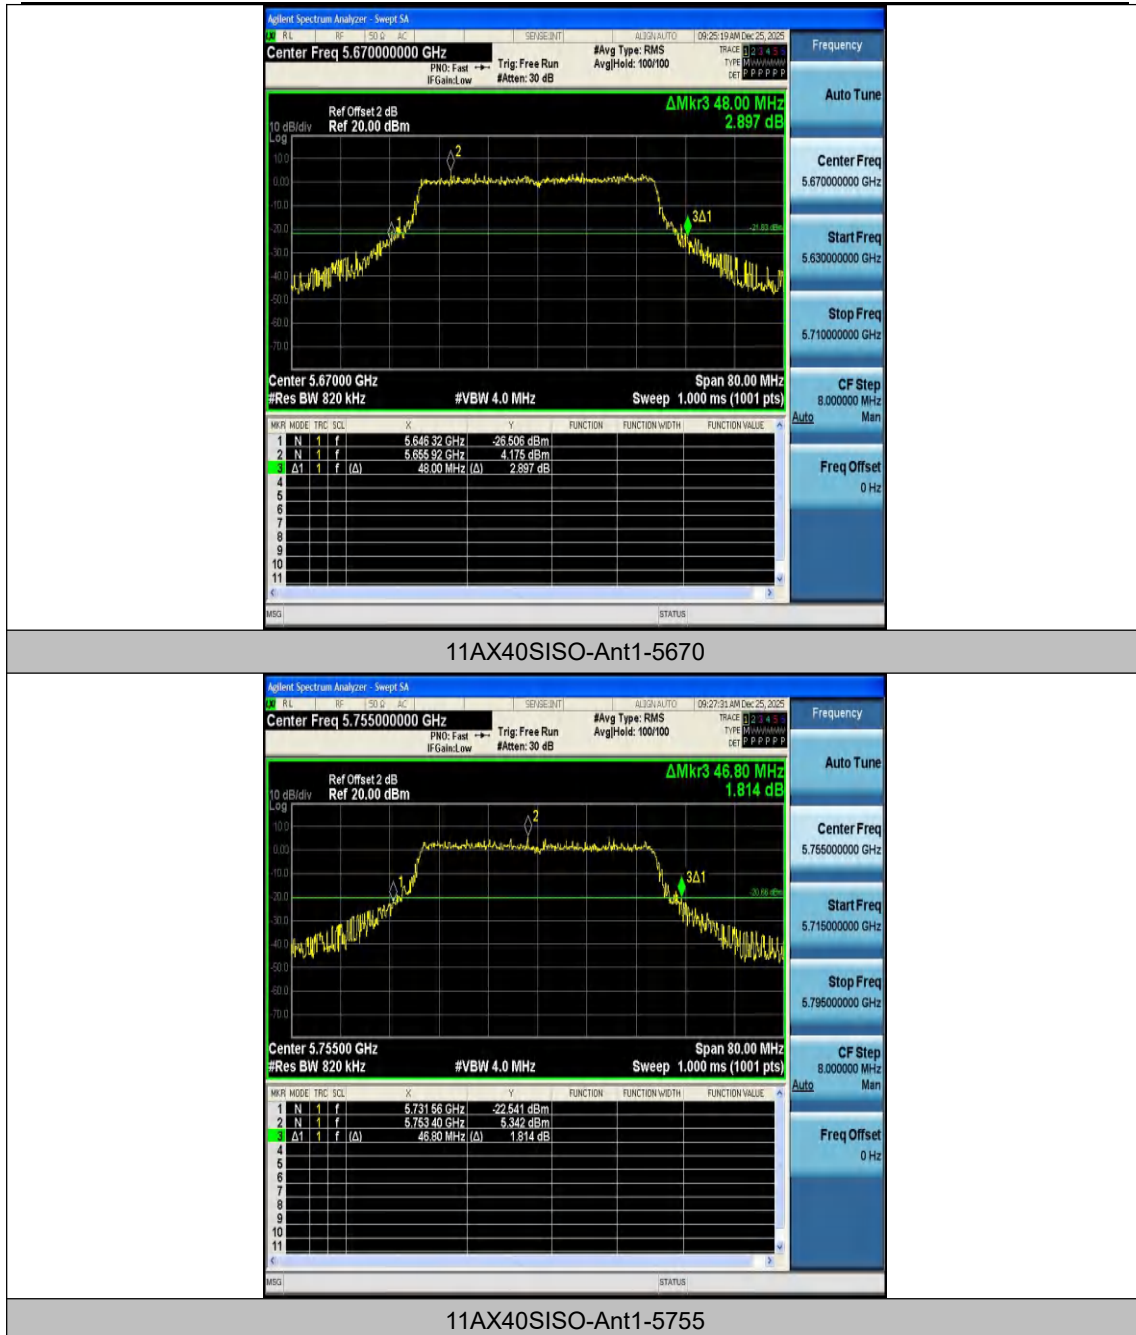


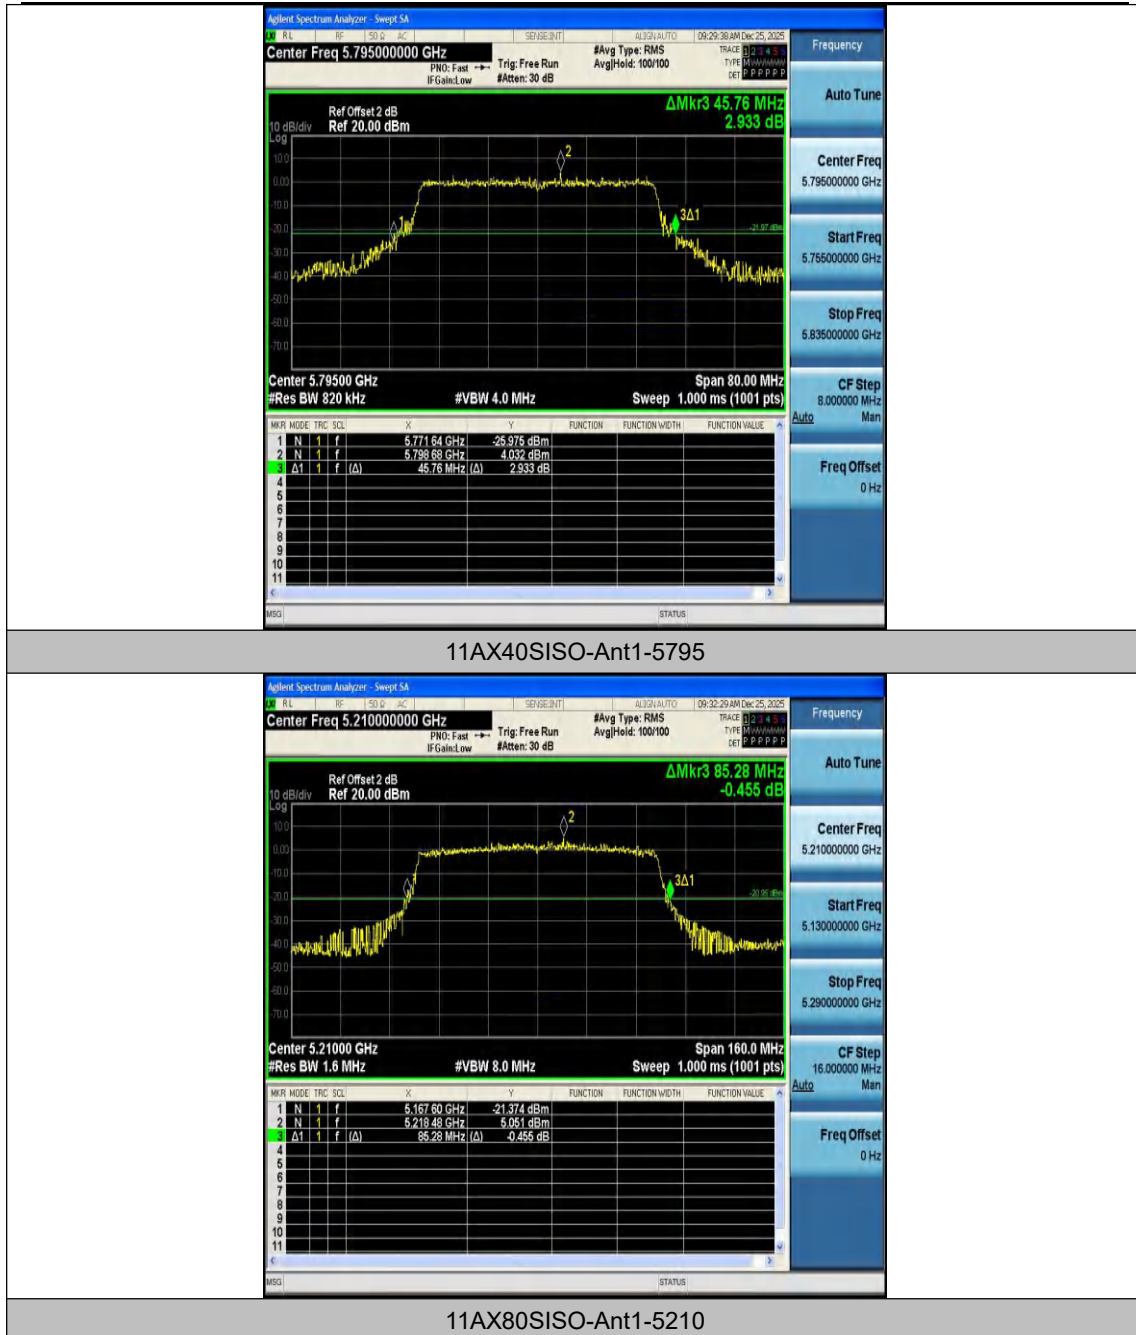


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

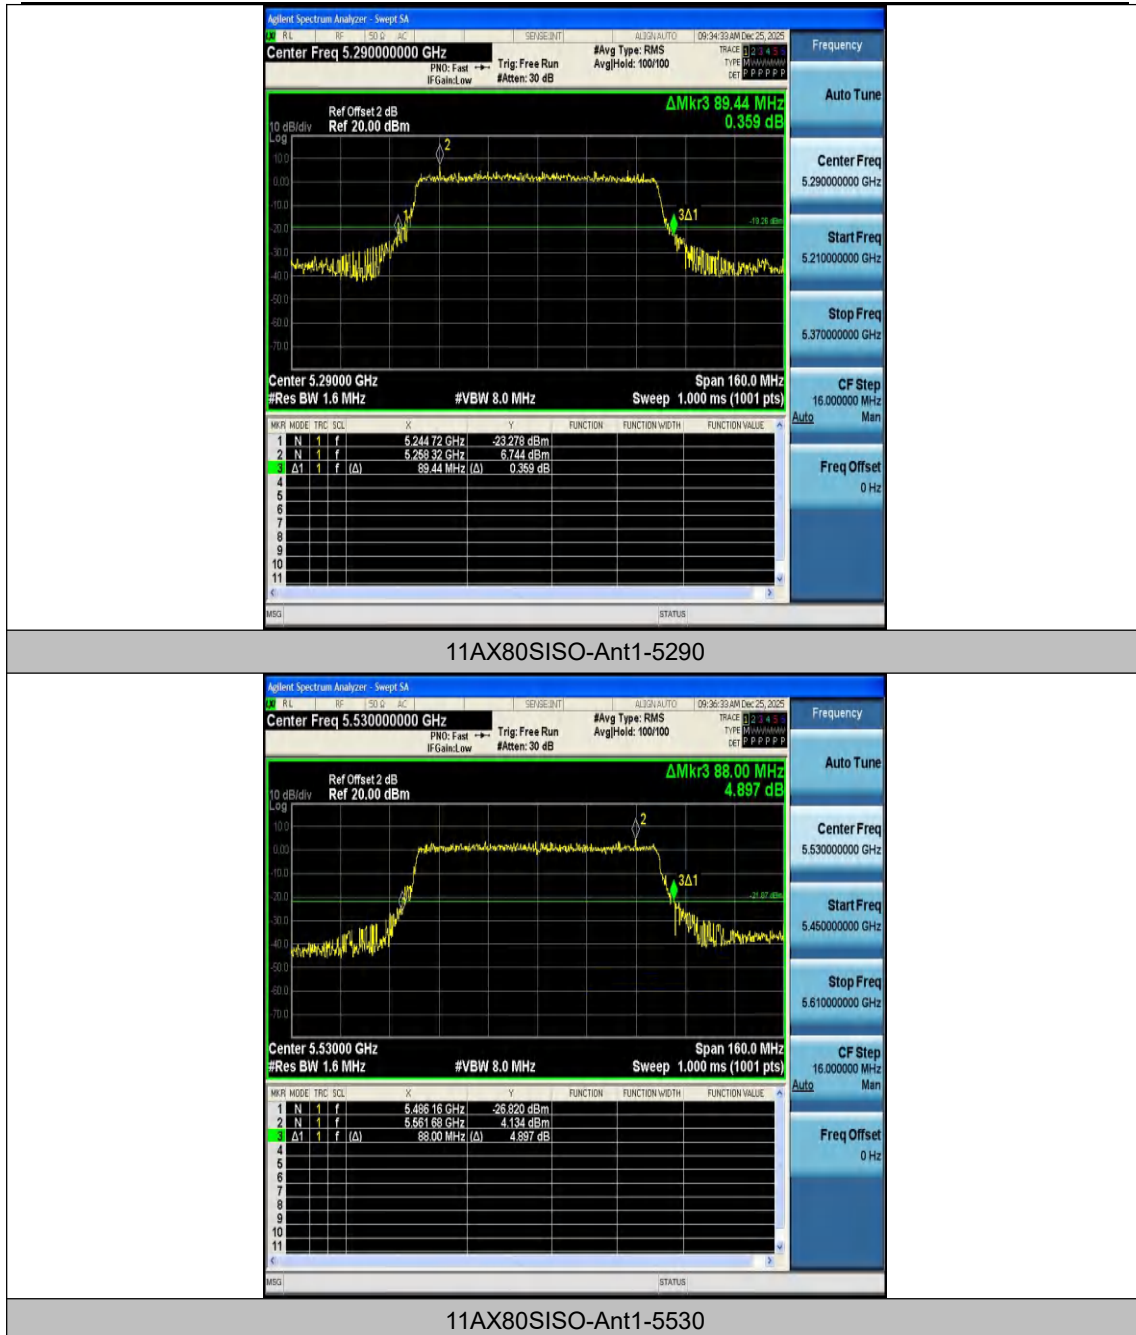

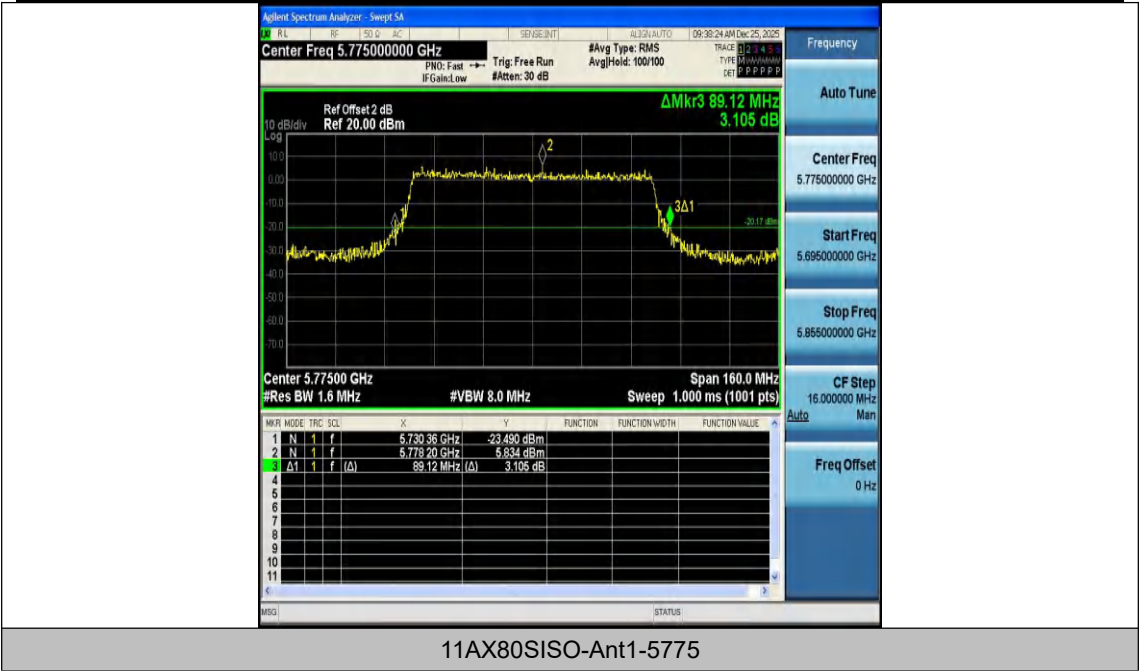

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.335	5171.3779	5188.7129	---	---
11A	Ant1	5220	17.339	5211.3419	5228.6809	---	---
11A	Ant1	5240	17.389	5231.2340	5248.6230	---	---
11A	Ant1	5260	17.457	5251.1844	5268.6414	---	---
11A	Ant1	5300	17.528	5291.2910	5308.8190	---	---
11A	Ant1	5320	17.415	5311.3875	5328.8025	---	---
11A	Ant1	5500	17.554	5491.2508	5508.8048	---	---
11A	Ant1	5580	17.688	5571.2312	5588.9192	---	---
11A	Ant1	5700	17.689	5691.1870	5708.8760	---	---
11A	Ant1	5745	17.681	5736.0921	5753.7731	---	---
11A	Ant1	5785	17.598	5776.1657	5793.7637	---	---
11A	Ant1	5825	17.631	5816.1547	5833.7857	---	---
11N20SISO	Ant1	5180	18.501	5170.8334	5189.3344	---	---
11N20SISO	Ant1	5220	18.451	5210.8261	5229.2771	---	---
11N20SISO	Ant1	5240	18.583	5230.7050	5249.2880	---	---
11N20SISO	Ant1	5260	18.606	5250.6741	5269.2801	---	---
11N20SISO	Ant1	5300	18.539	5290.7382	5309.2772	---	---
11N20SISO	Ant1	5320	18.521	5310.7877	5329.3087	---	---
11N20SISO	Ant1	5500	18.736	5490.7062	5509.4422	---	---
11N20SISO	Ant1	5580	18.810	5570.7090	5589.5190	---	---
11N20SISO	Ant1	5700	18.622	5690.7307	5709.3527	---	---
11N20SISO	Ant1	5745	18.758	5735.5867	5754.3447	---	---
11N20SISO	Ant1	5785	18.738	5775.6098	5794.3478	---	---
11N20SISO	Ant1	5825	18.718	5815.6709	5834.3889	---	---
11N40SISO	Ant1	5190	36.935	5171.6643	5208.5993	---	---
11N40SISO	Ant1	5230	36.866	5211.6318	5248.4978	---	---
11N40SISO	Ant1	5270	36.726	5251.6245	5288.3505	---	---
11N40SISO	Ant1	5310	36.977	5291.6586	5328.6356	---	---
11N40SISO	Ant1	5510	36.941	5491.6618	5528.6028	---	---
11N40SISO	Ant1	5550	37.278	5531.4364	5568.7144	---	---
11N40SISO	Ant1	5670	37.392	5651.4515	5688.8435	---	---
11N40SISO	Ant1	5755	37.195	5736.3653	5773.5603	---	---
11N40SISO	Ant1	5795	37.393	5776.2913	5813.6843	---	---
11AC20SISO	Ant1	5180	18.511	5170.8080	5189.3190	---	---
11AC20SISO	Ant1	5220	18.478	5210.8017	5229.2797	---	---
11AC20SISO	Ant1	5240	18.501	5230.6911	5249.1921	---	---
11AC20SISO	Ant1	5260	18.546	5250.7051	5269.2511	---	---

11AC20SISO	Ant1	5300	18.626	5290.7559	5309.3819	---	---
11AC20SISO	Ant1	5320	18.558	5310.7873	5329.3453	---	---
11AC20SISO	Ant1	5500	18.692	5490.7262	5509.4182	---	---
11AC20SISO	Ant1	5580	18.798	5570.7374	5589.5354	---	---
11AC20SISO	Ant1	5700	18.809	5690.6627	5709.4717	---	---
11AC20SISO	Ant1	5745	18.817	5735.5584	5754.3754	---	---
11AC20SISO	Ant1	5785	18.758	5775.5877	5794.3457	---	---
11AC20SISO	Ant1	5825	18.890	5815.6364	5834.5264	---	---
11AC40SISO	Ant1	5190	36.737	5171.7530	5208.4900	---	---
11AC40SISO	Ant1	5230	36.851	5211.5707	5248.4217	---	---
11AC40SISO	Ant1	5270	36.982	5251.4651	5288.4471	---	---
11AC40SISO	Ant1	5310	37.005	5291.6280	5328.6330	---	---
11AC40SISO	Ant1	5510	37.063	5491.6085	5528.6715	---	---
11AC40SISO	Ant1	5550	37.231	5531.4845	5568.7155	---	---
11AC40SISO	Ant1	5670	37.251	5651.4179	5688.6689	---	---
11AC40SISO	Ant1	5755	37.252	5736.2891	5773.5411	---	---
11AC40SISO	Ant1	5795	37.442	5776.2914	5813.7334	---	---
11AC80SISO	Ant1	5210	75.899	5172.1538	5248.0528	---	---
11AC80SISO	Ant1	5290	76.473	5251.7517	5328.2247	---	---
11AC80SISO	Ant1	5530	76.448	5491.8587	5568.3067	---	---
11AC80SISO	Ant1	5775	76.691	5736.6192	5813.3102	---	---
11AX20SISO	Ant1	5180	19.362	5170.3873	5189.7493	---	---
11AX20SISO	Ant1	5220	19.320	5210.3674	5229.6874	---	---
11AX20SISO	Ant1	5240	19.344	5230.2646	5249.6086	---	---
11AX20SISO	Ant1	5260	19.381	5250.3199	5269.7009	---	---
11AX20SISO	Ant1	5300	19.488	5290.3200	5309.8080	---	---
11AX20SISO	Ant1	5320	19.283	5310.4130	5329.6960	---	---
11AX20SISO	Ant1	5500	19.444	5490.3252	5509.7692	---	---
11AX20SISO	Ant1	5580	19.425	5570.3580	5589.7830	---	---
11AX20SISO	Ant1	5700	19.456	5690.3775	5709.8335	---	---
11AX20SISO	Ant1	5745	19.430	5735.2955	5754.7255	---	---
11AX20SISO	Ant1	5785	19.495	5775.3221	5794.8171	---	---
11AX20SISO	Ant1	5825	19.499	5815.2873	5834.7863	---	---
11AX40SISO	Ant1	5190	38.171	5170.9912	5209.1622	---	---
11AX40SISO	Ant1	5230	38.136	5210.9617	5249.0977	---	---
11AX40SISO	Ant1	5270	38.253	5250.8463	5289.0993	---	---
11AX40SISO	Ant1	5310	38.219	5291.0432	5329.2622	---	---
11AX40SISO	Ant1	5510	38.213	5490.9890	5529.2020	---	---
11AX40SISO	Ant1	5550	38.439	5530.8795	5569.3185	---	---
11AX40SISO	Ant1	5670	38.411	5650.9386	5689.3496	---	---
11AX40SISO	Ant1	5755	38.405	5735.7664	5774.1714	---	---
11AX40SISO	Ant1	5795	38.405	5775.8334	5814.2384	---	---


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX80SISO	Ant1	5210	77.522	5171.3552	5248.8772	---	---
11AX80SISO	Ant1	5290	77.776	5251.1235	5328.8995	---	---
11AX80SISO	Ant1	5530	77.882	5491.2614	5569.1434	---	---
11AX80SISO	Ant1	5775	77.979	5735.9025	5813.8815	---	---


Test Graphs

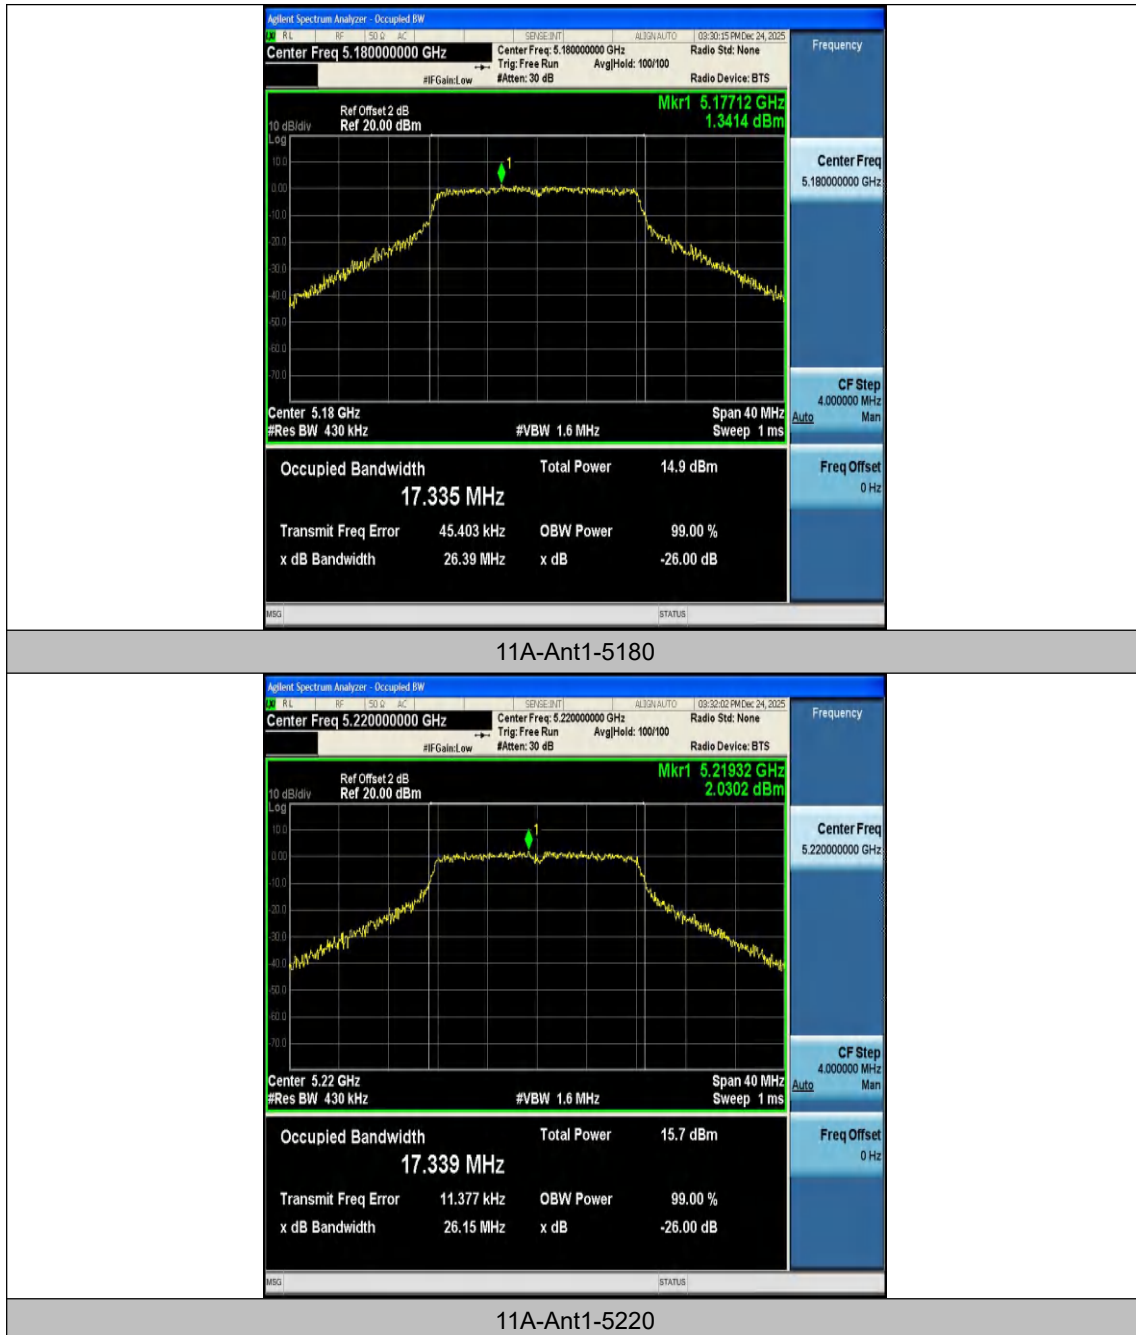

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

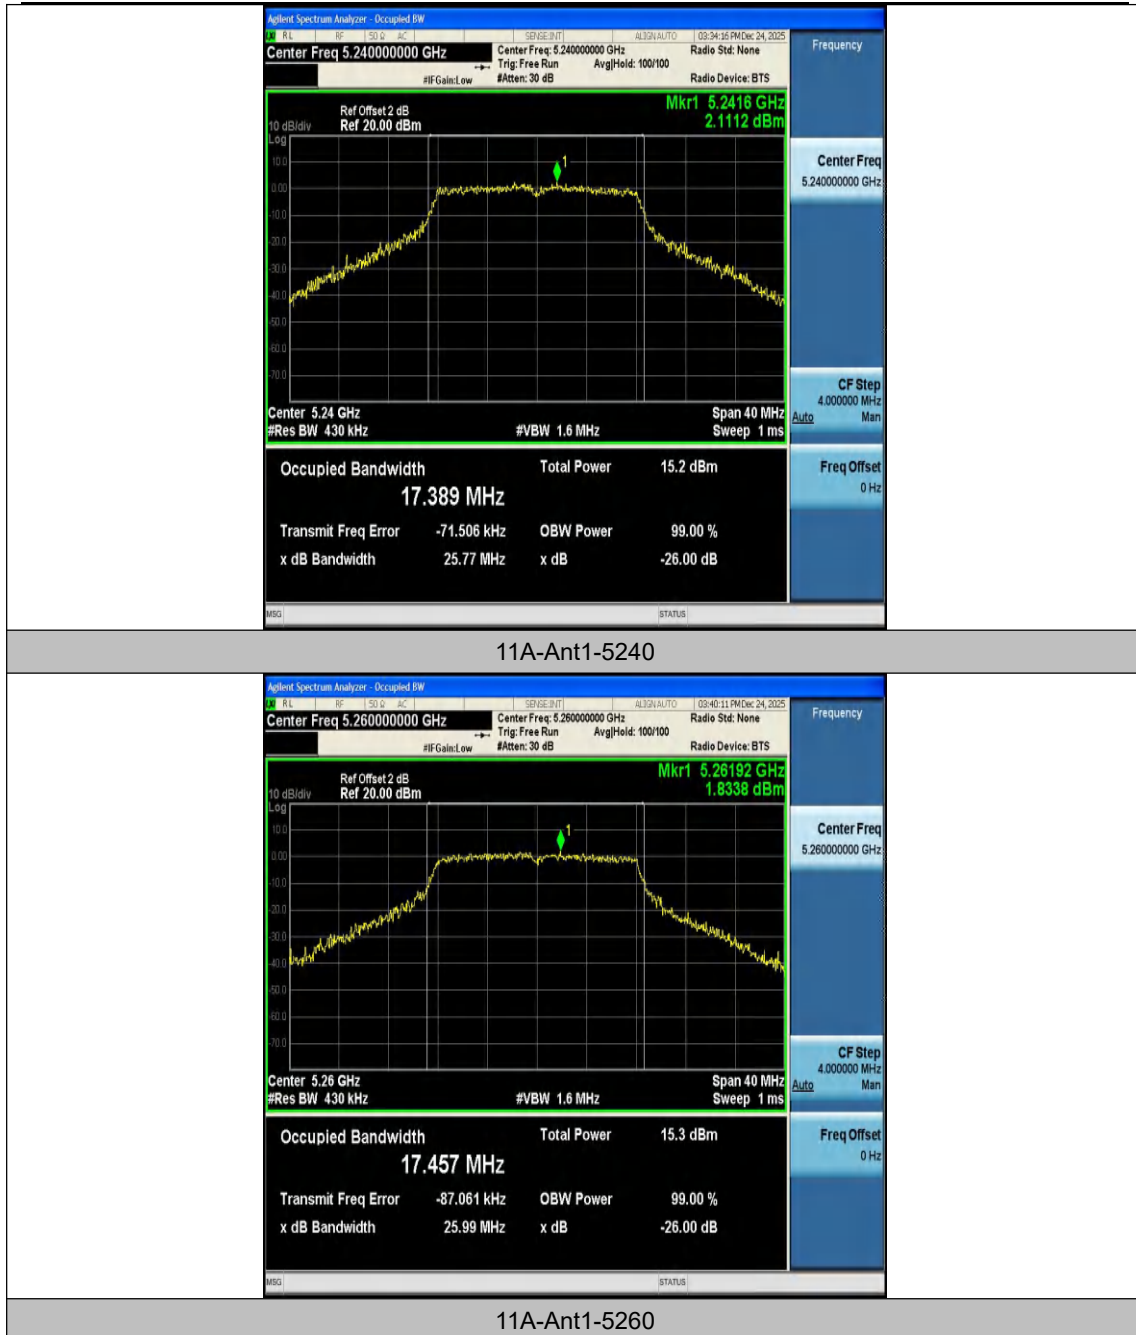

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com






Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

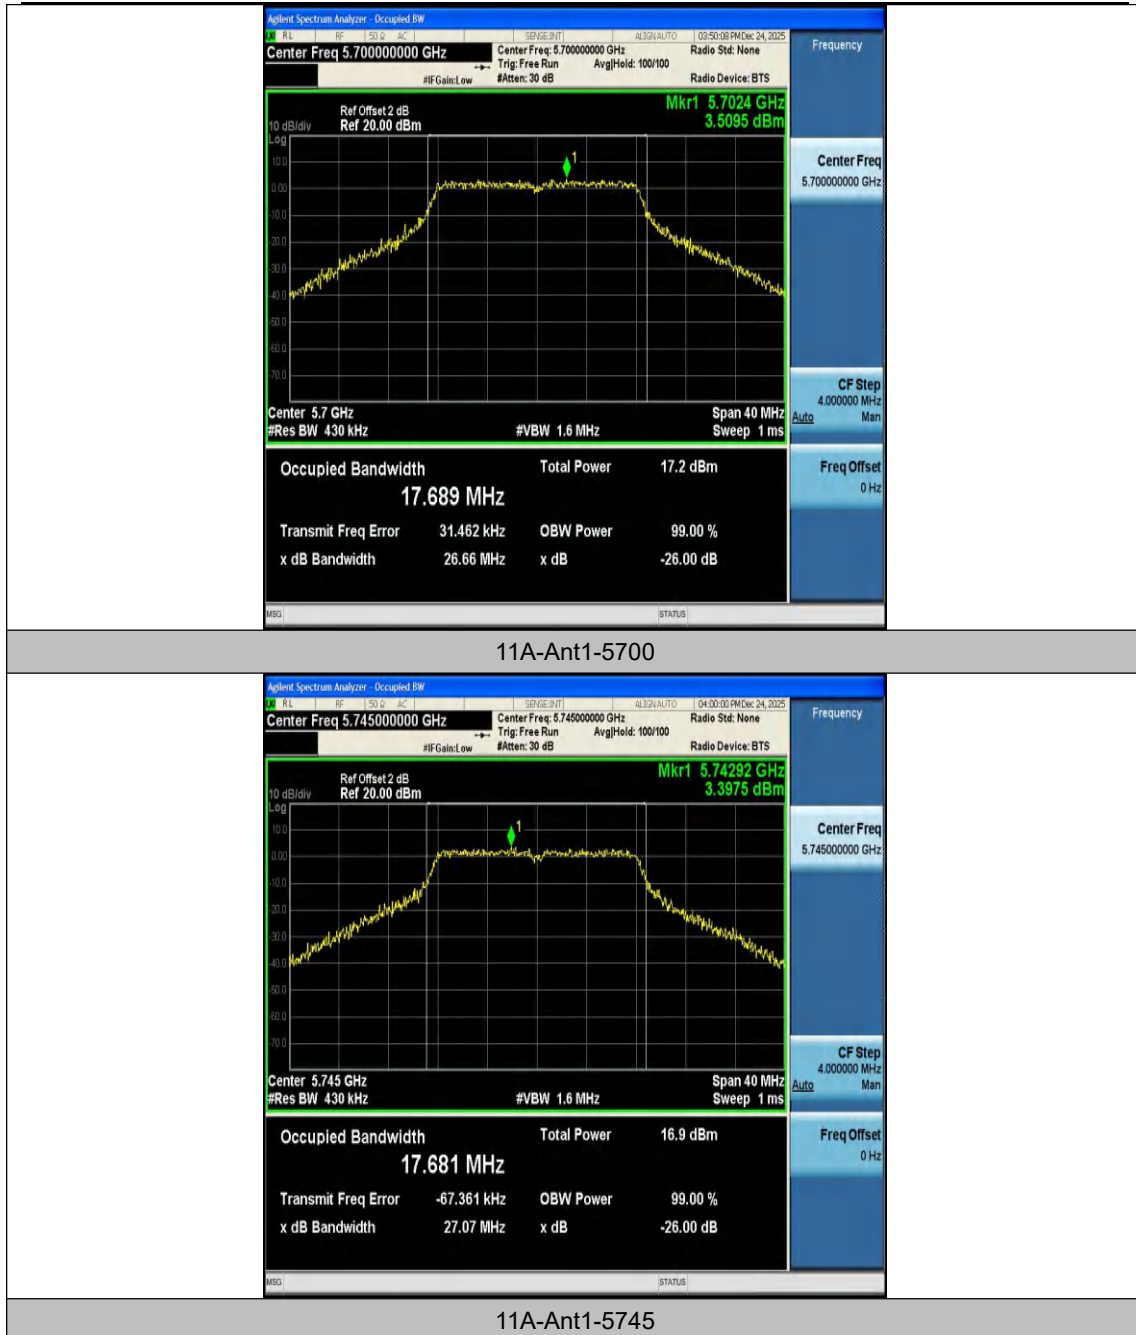


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

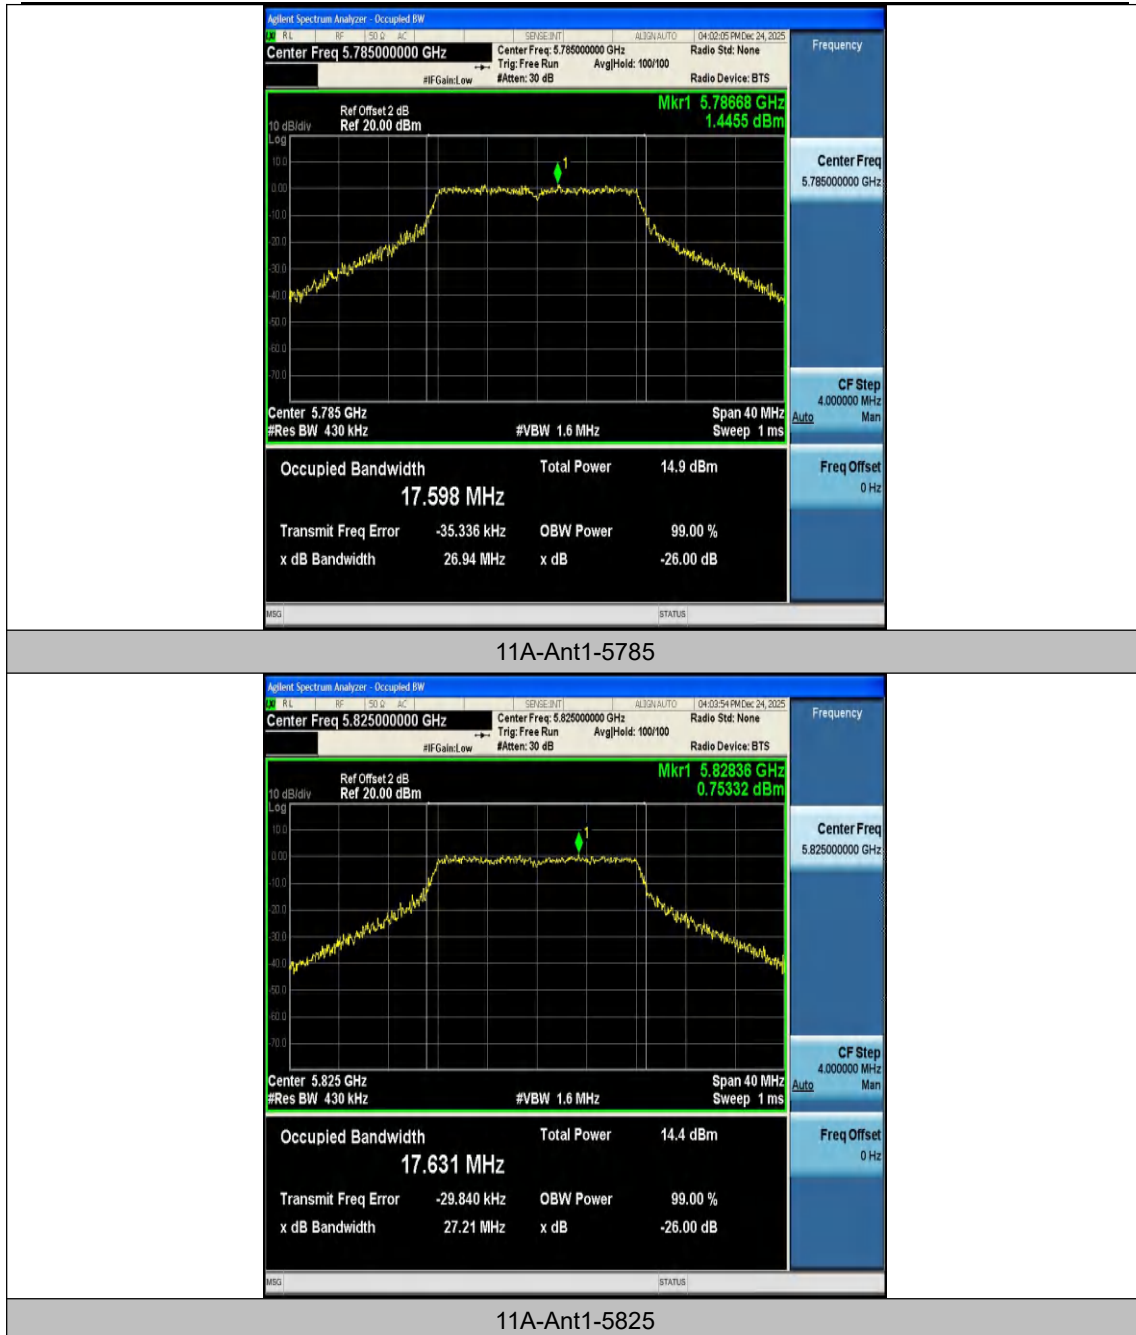


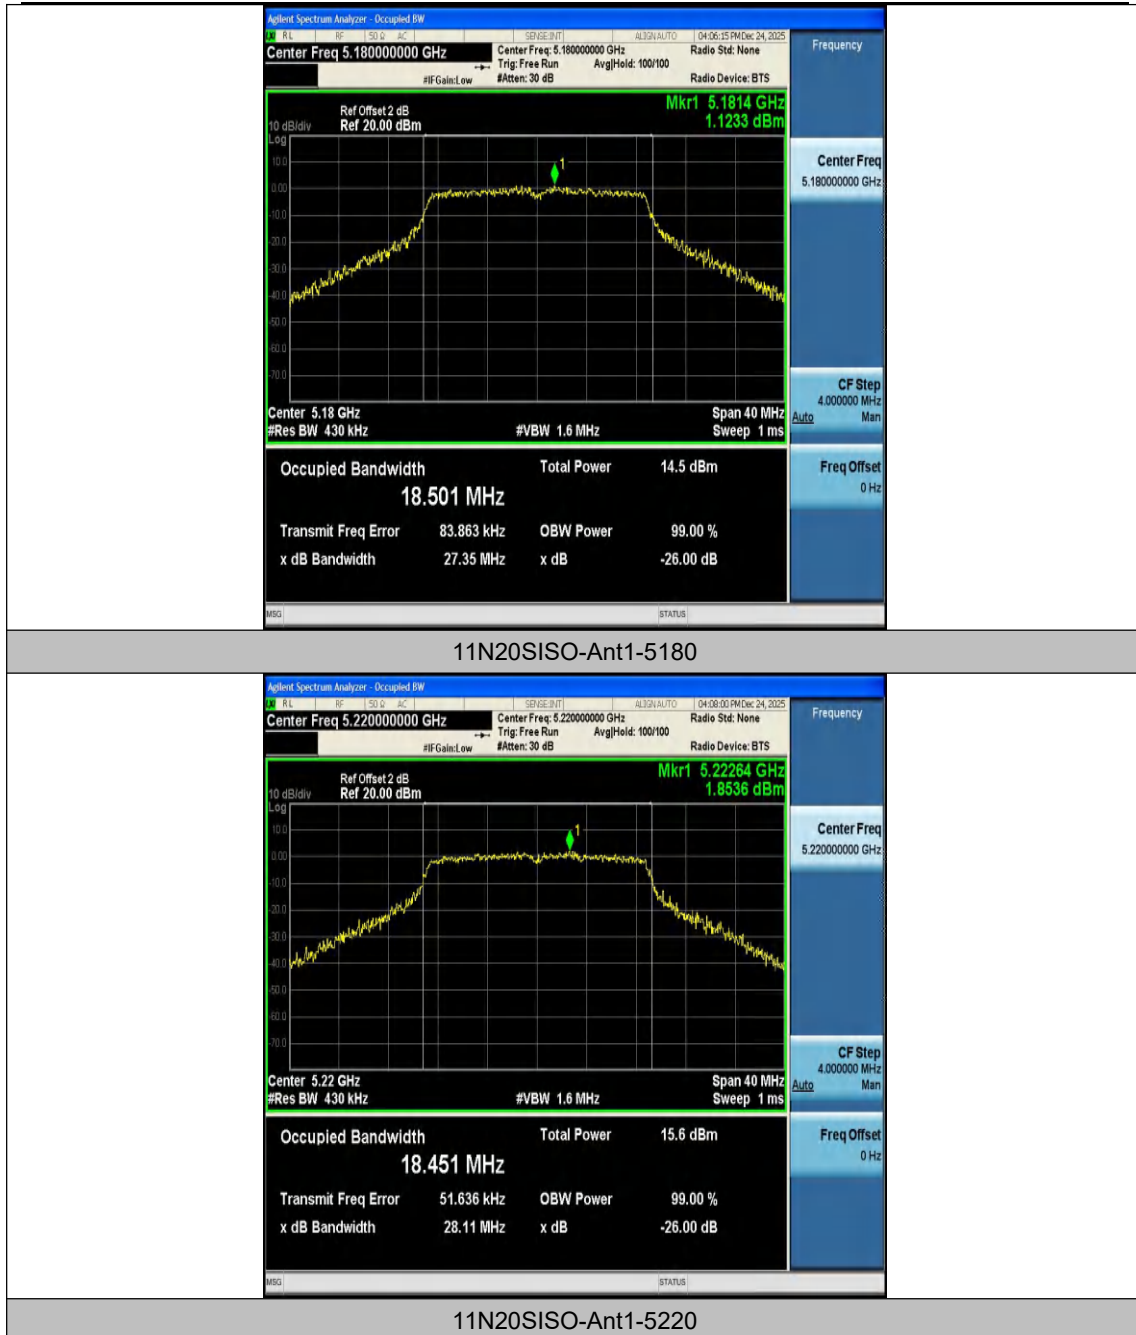

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

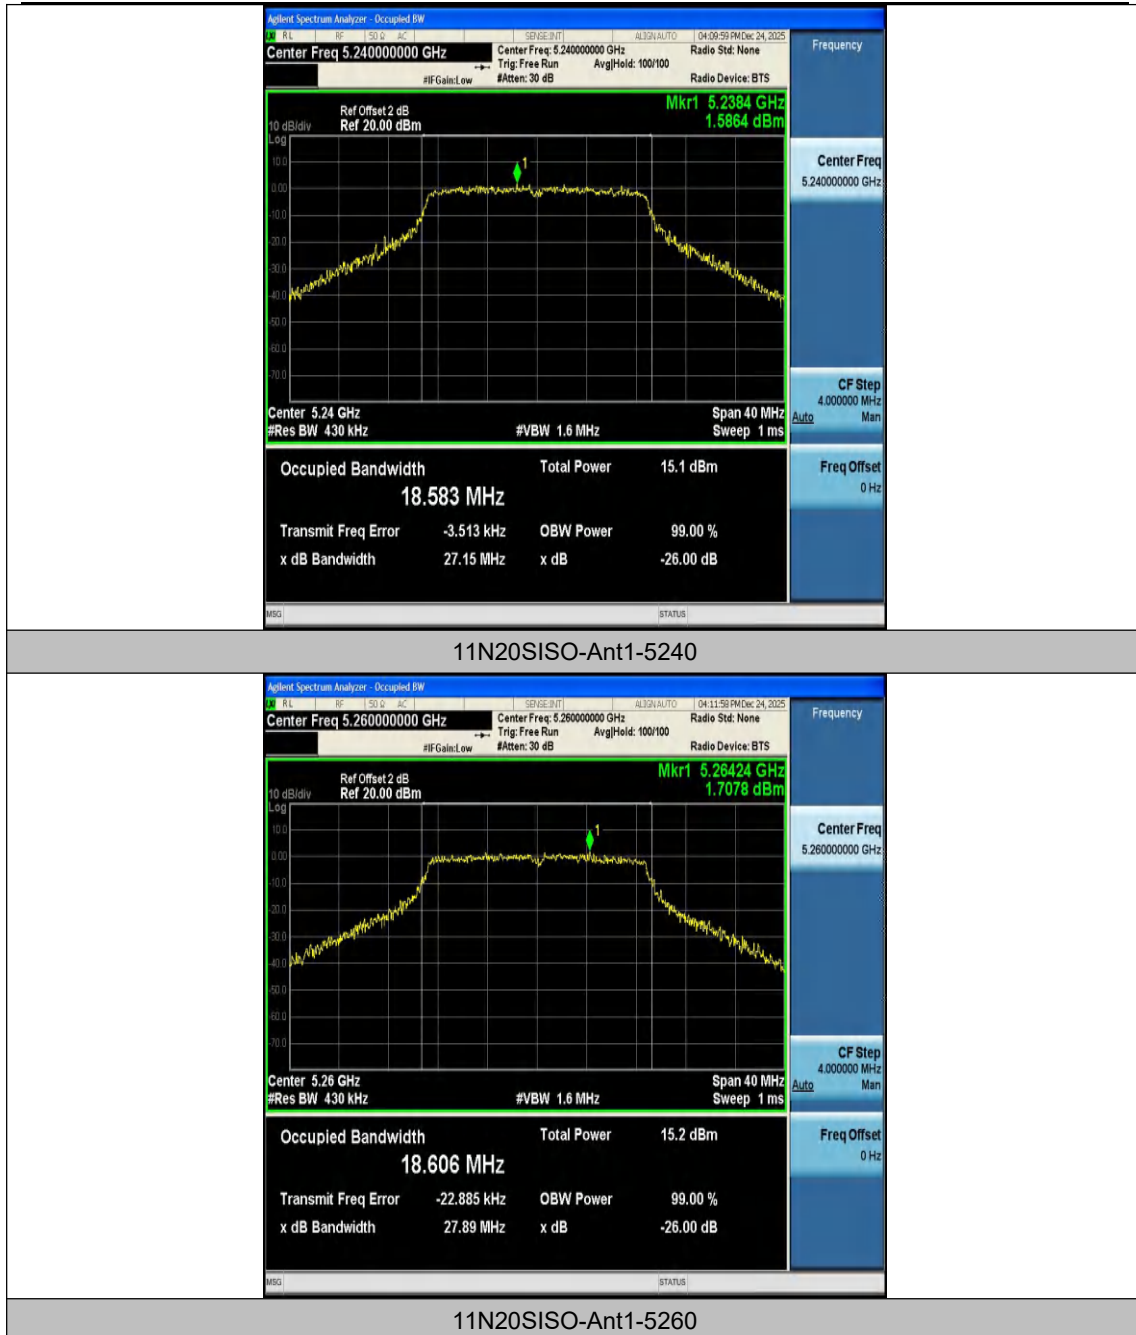

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

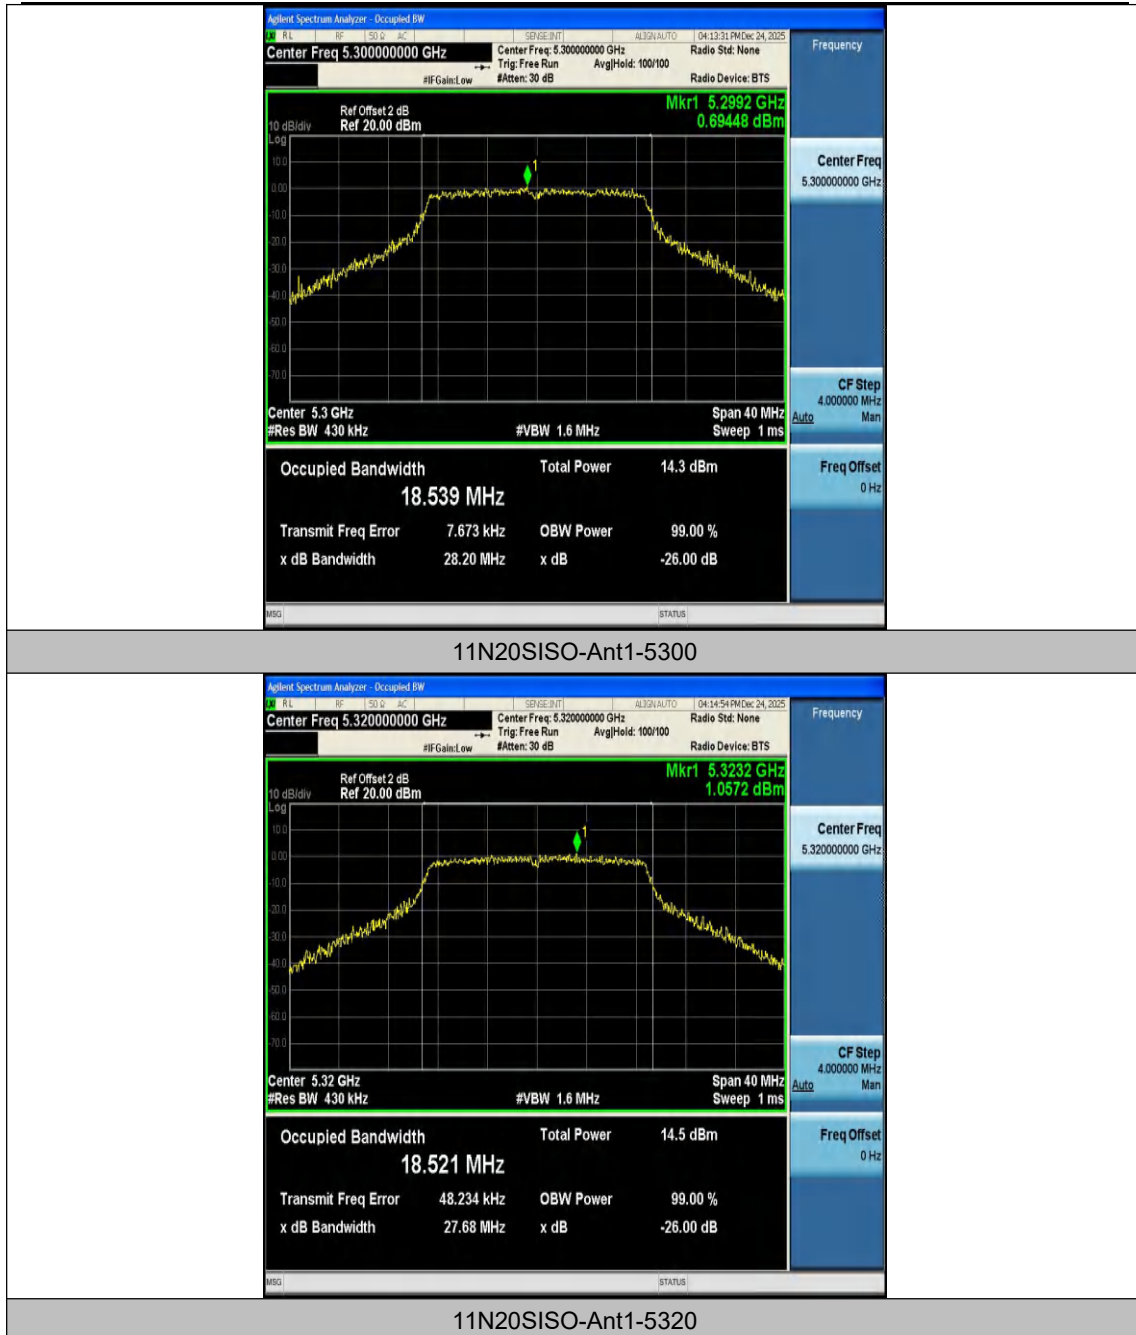

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

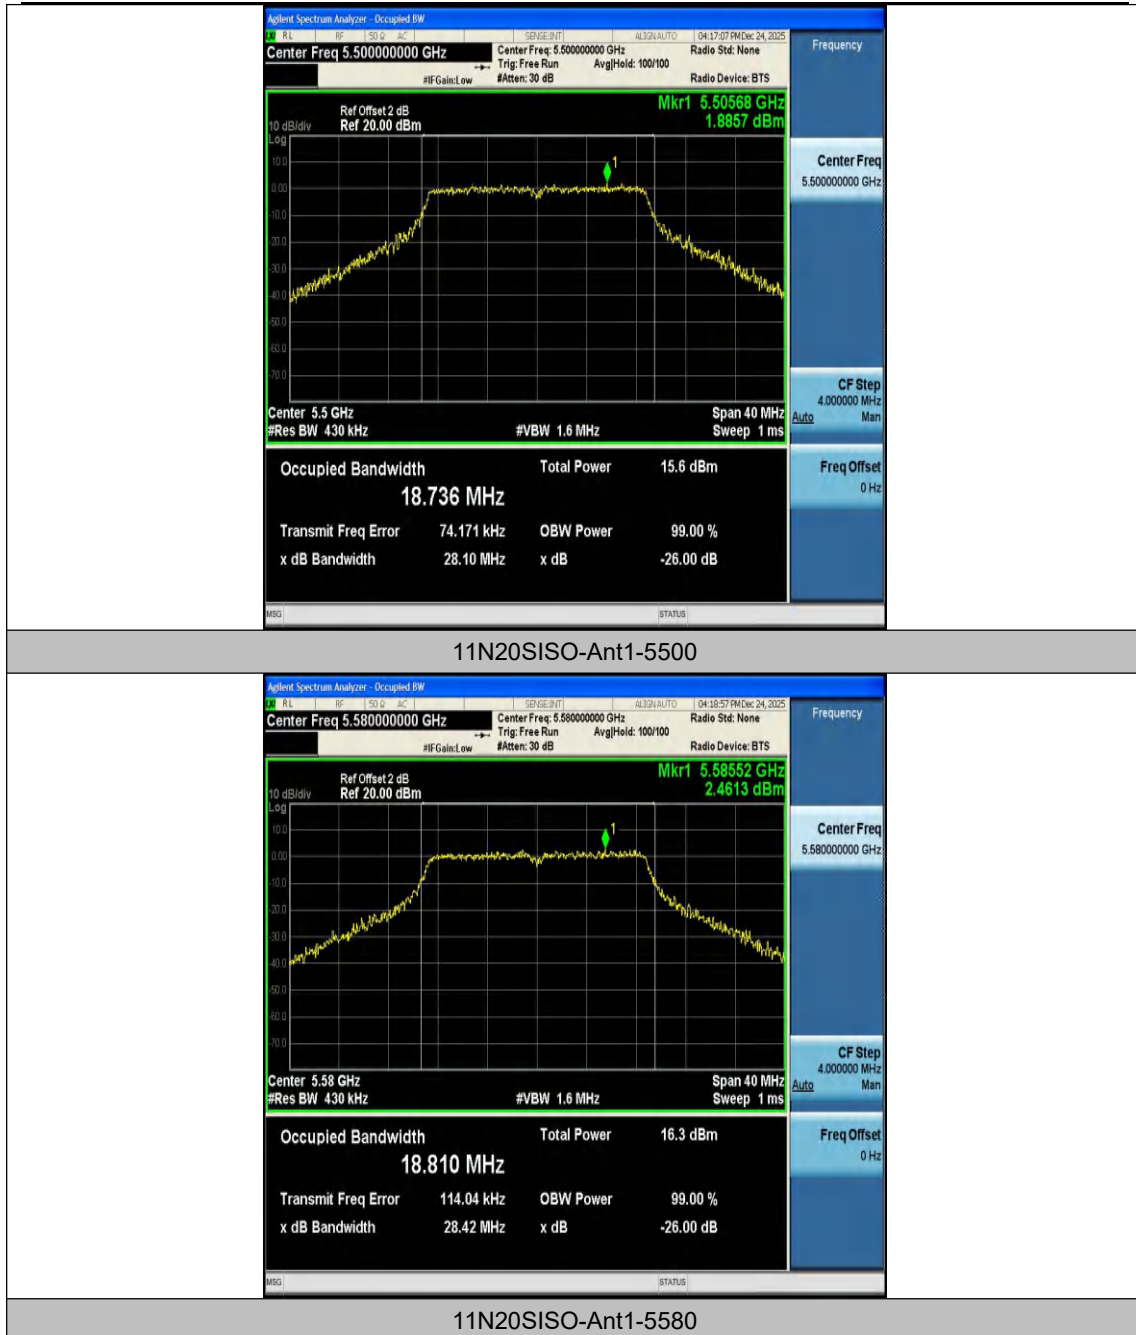

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

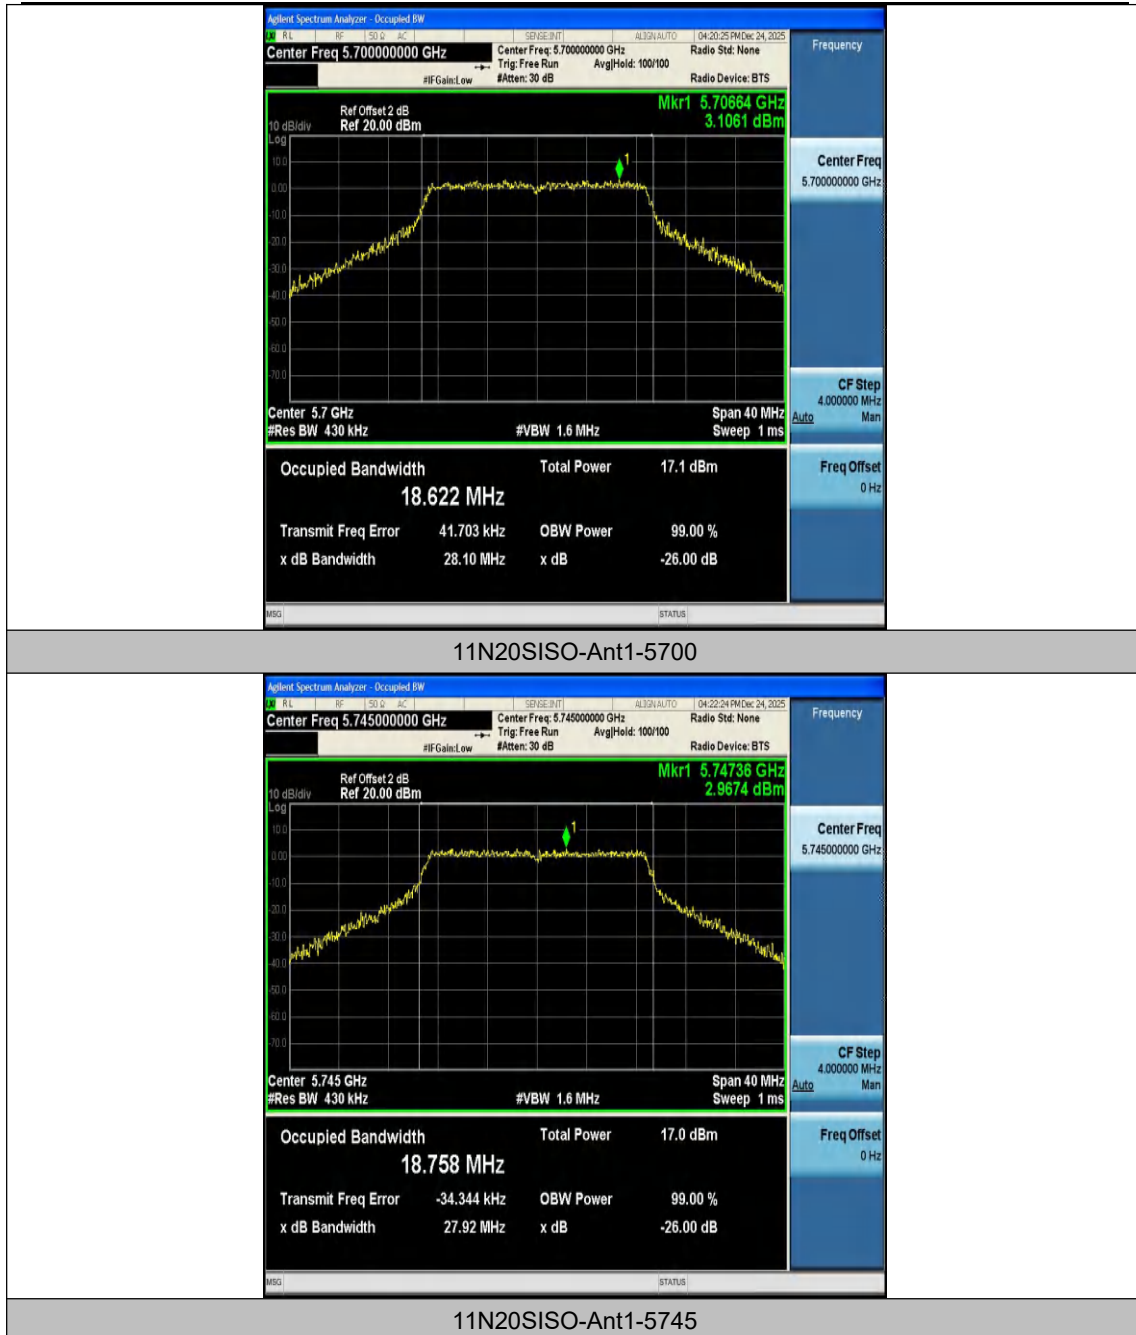

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

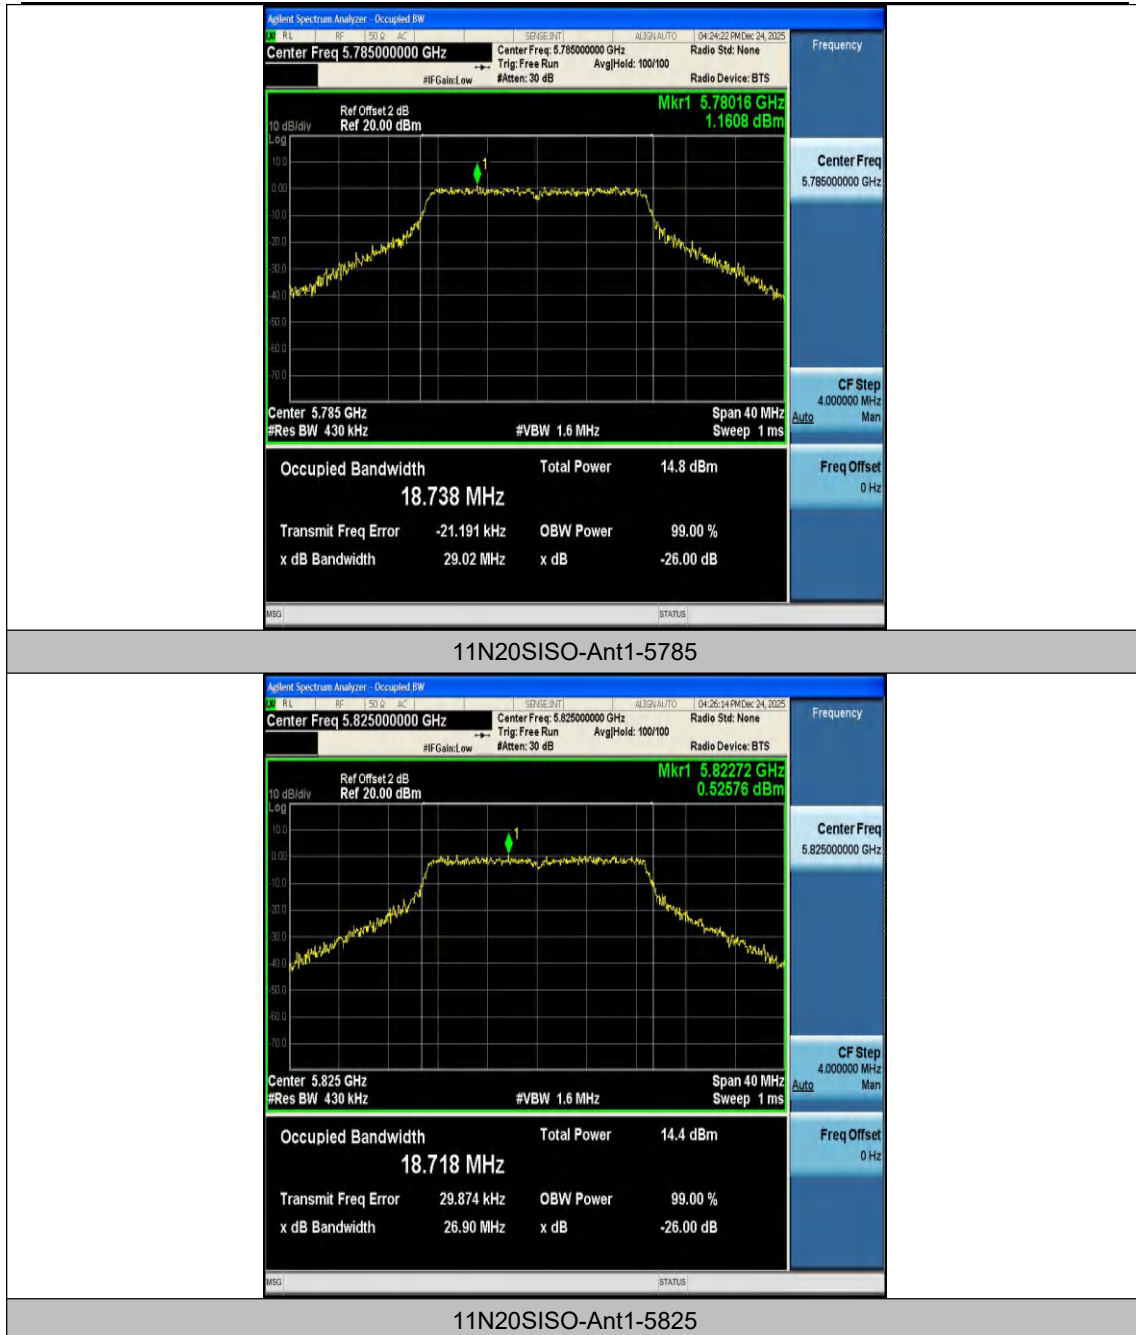

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

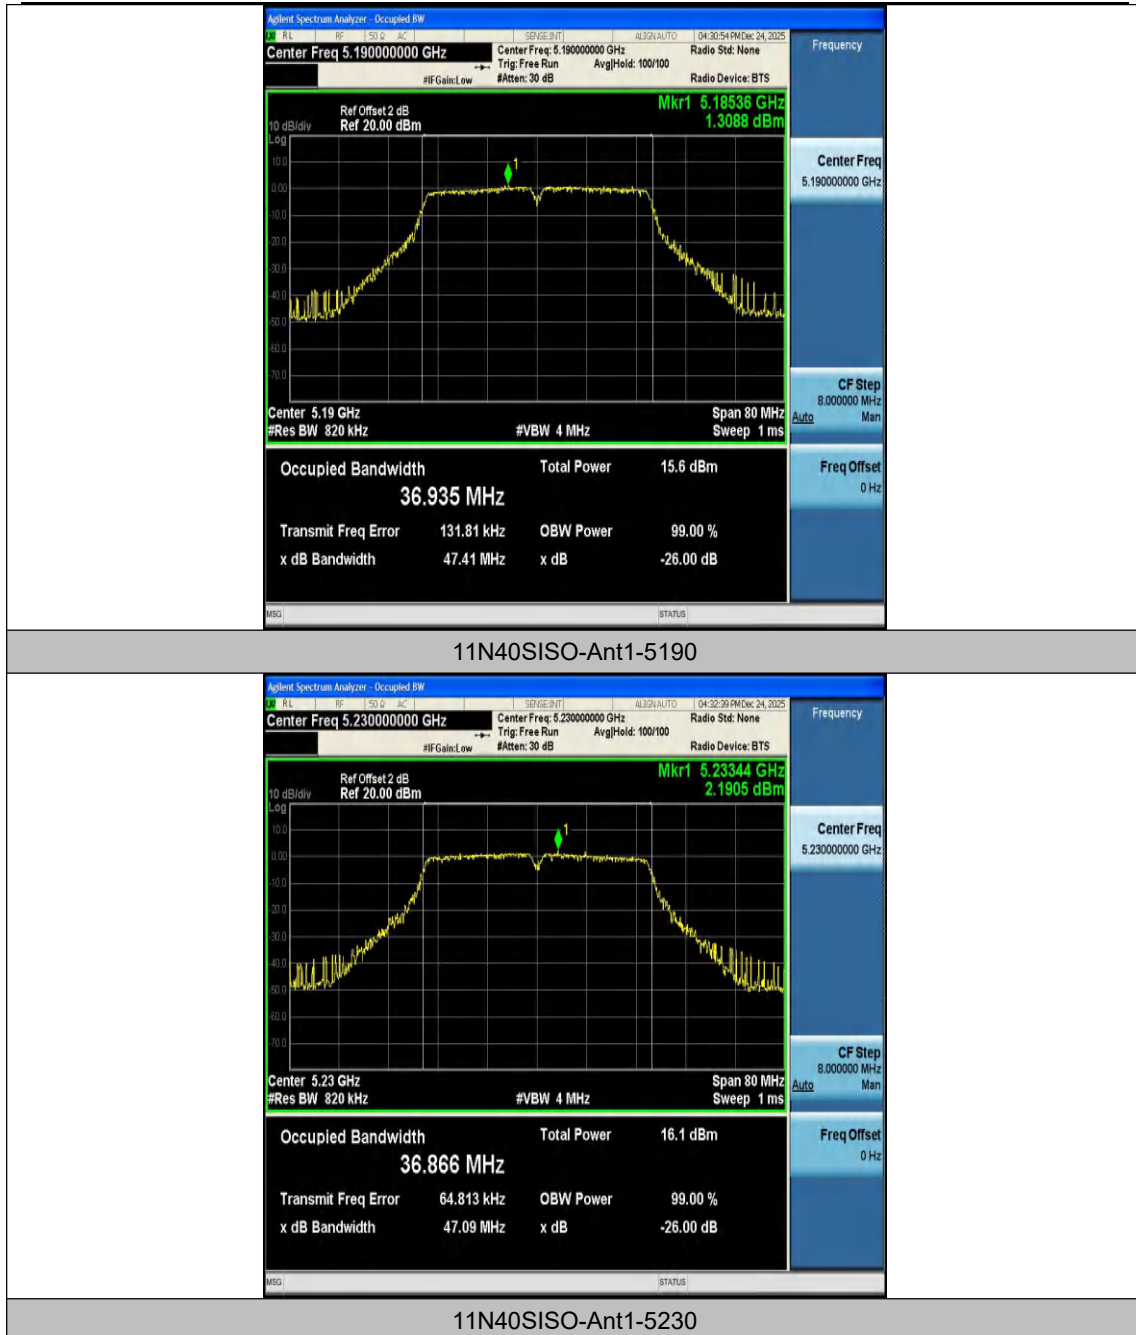

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

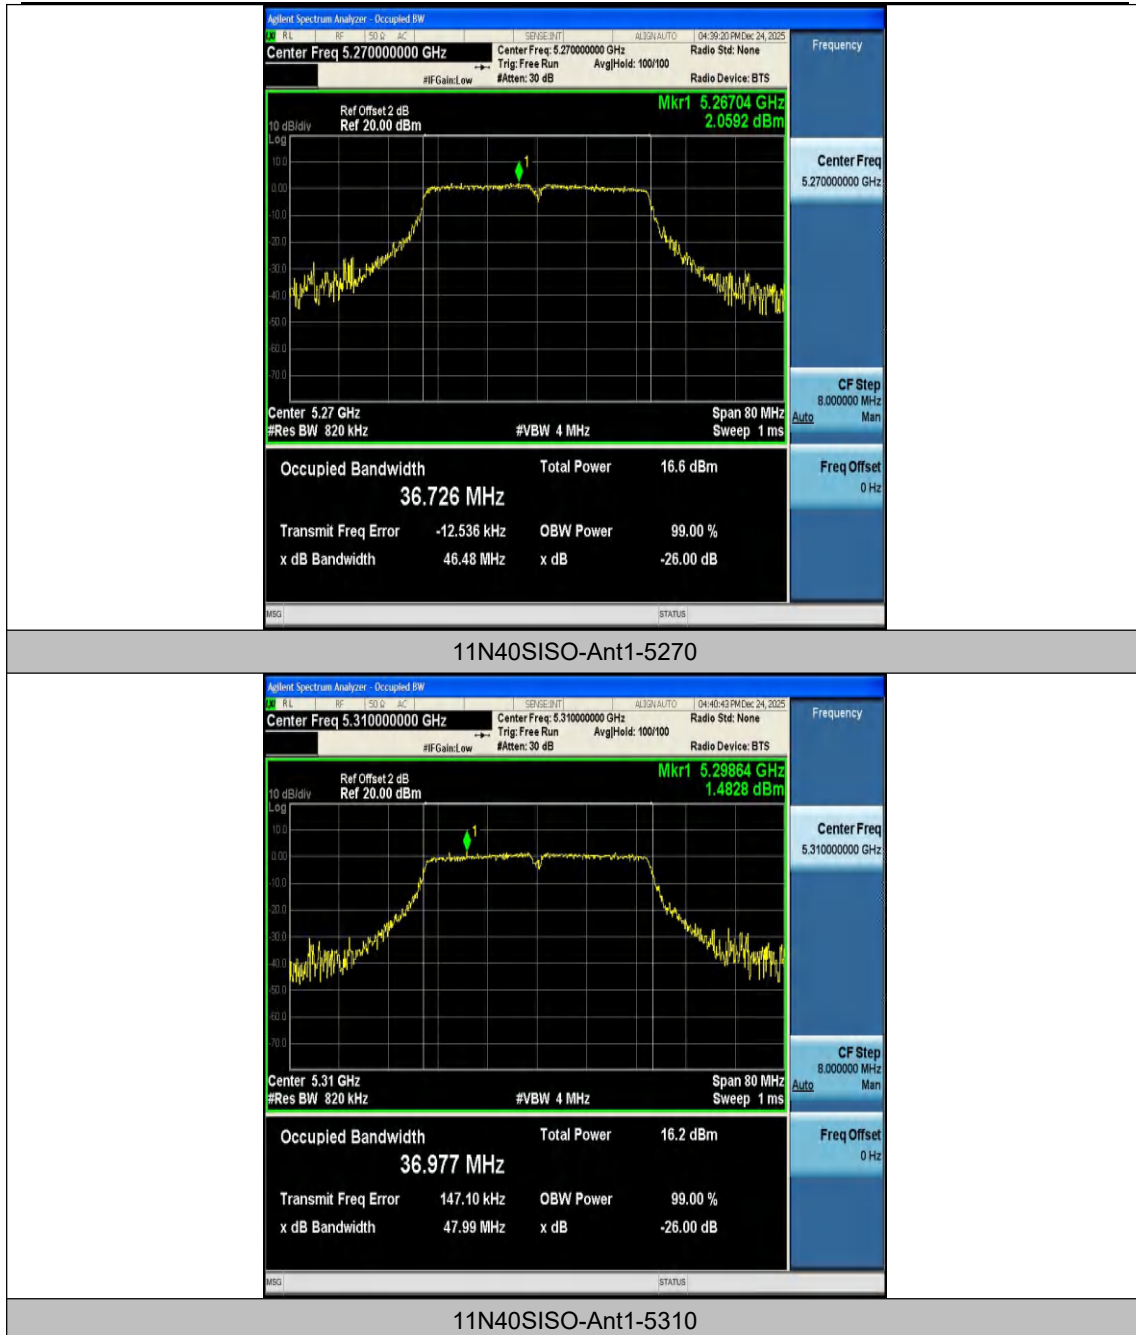

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

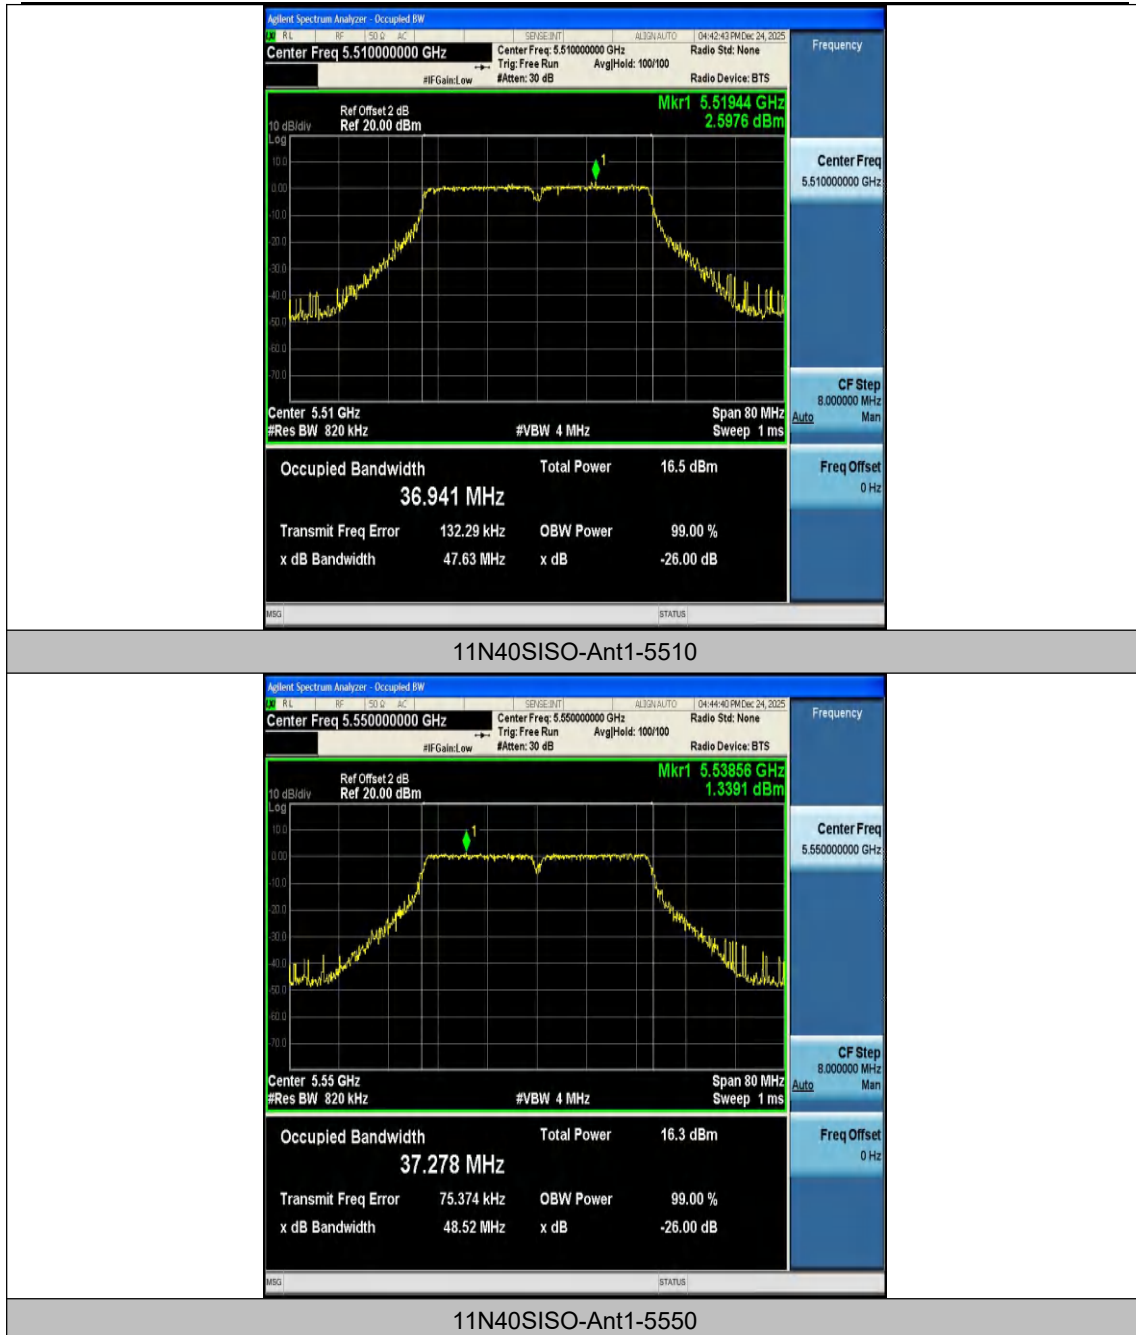

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

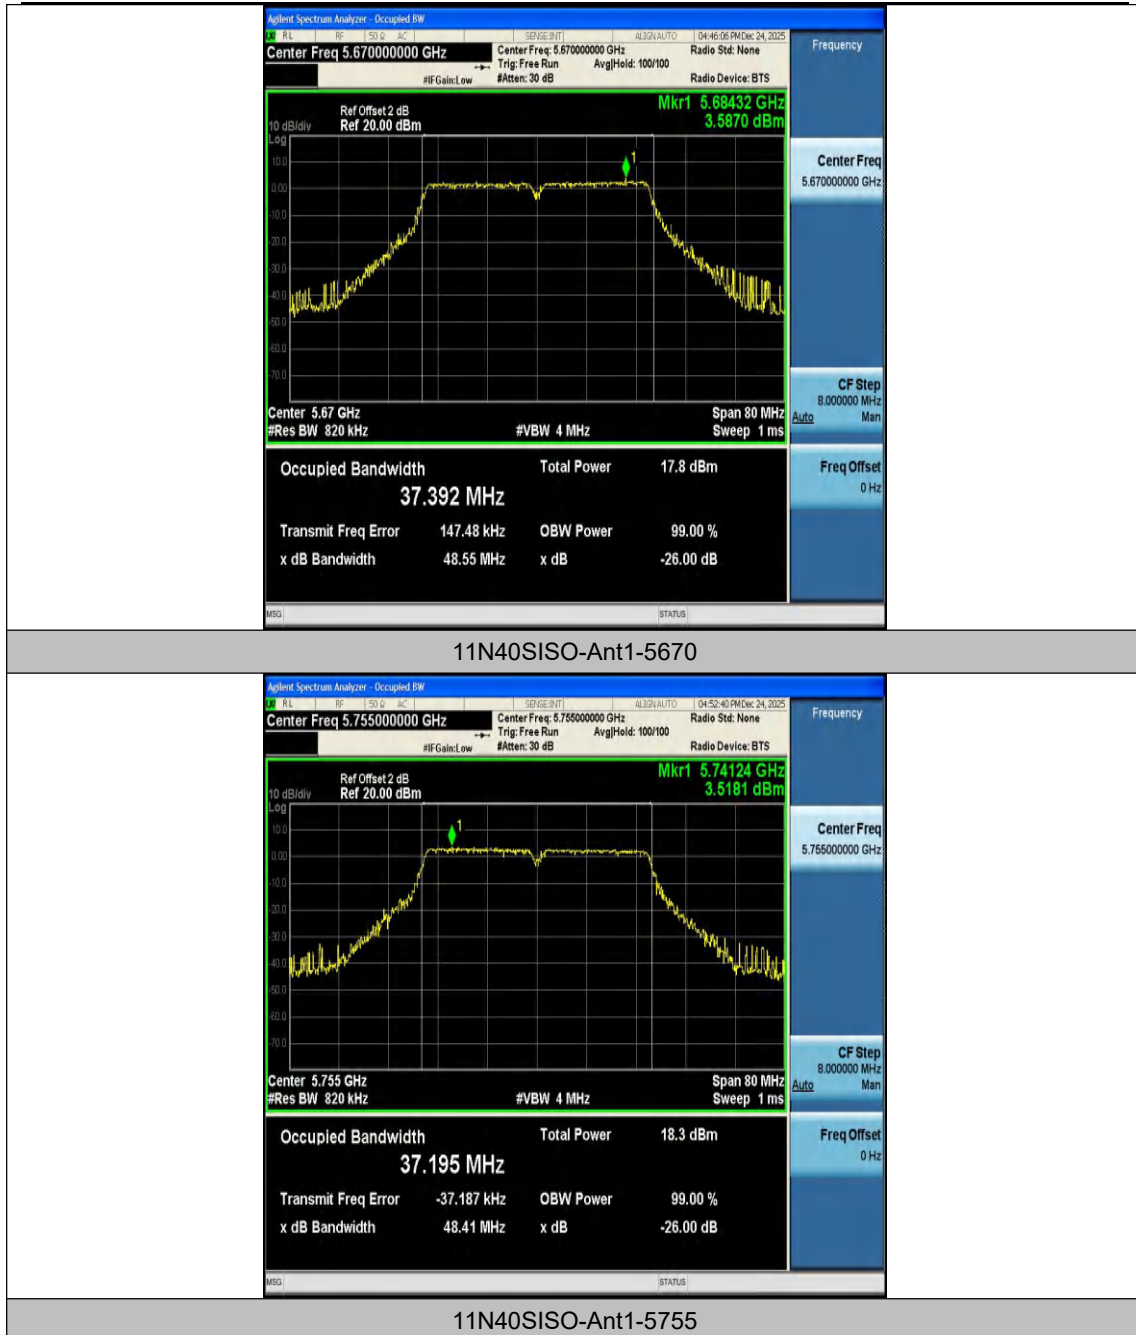

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

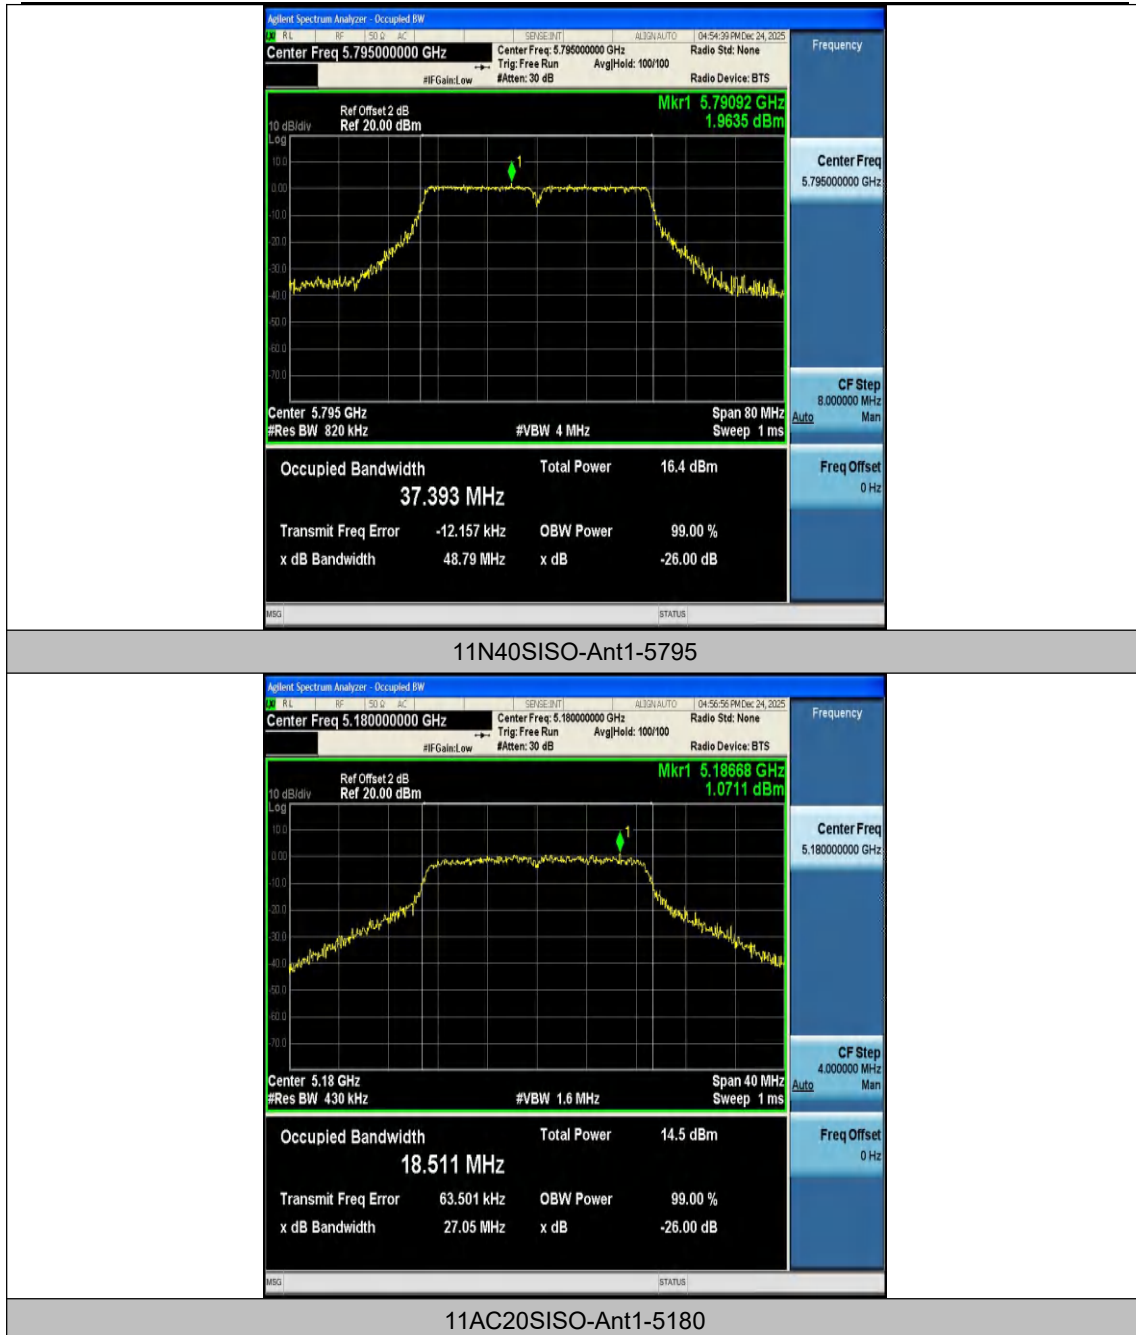

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

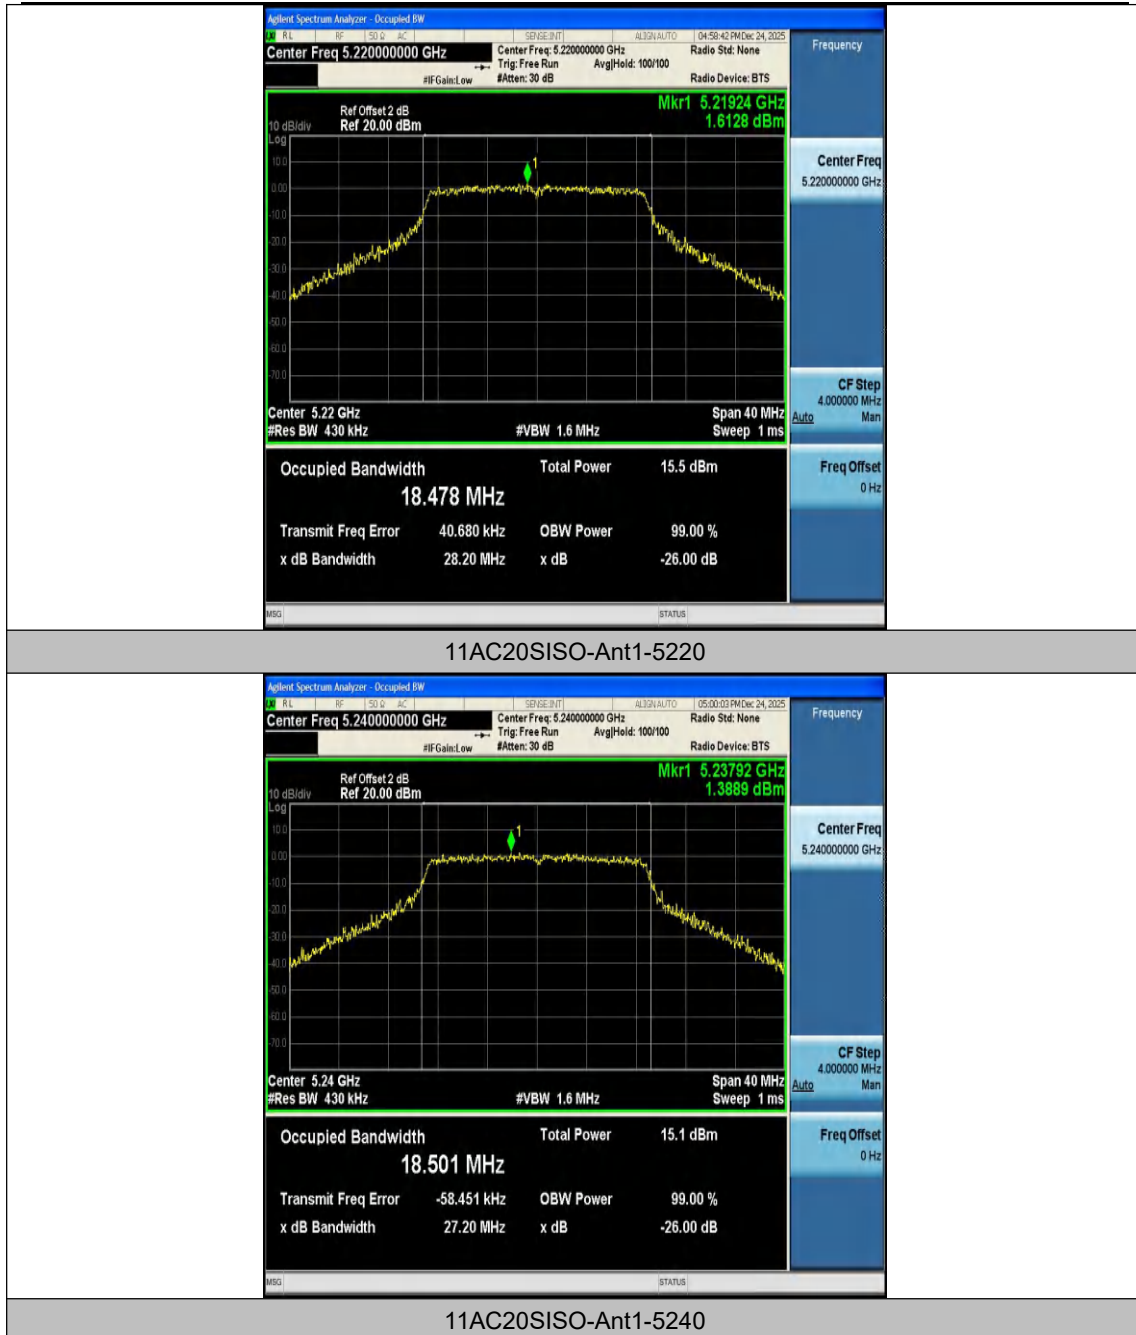

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

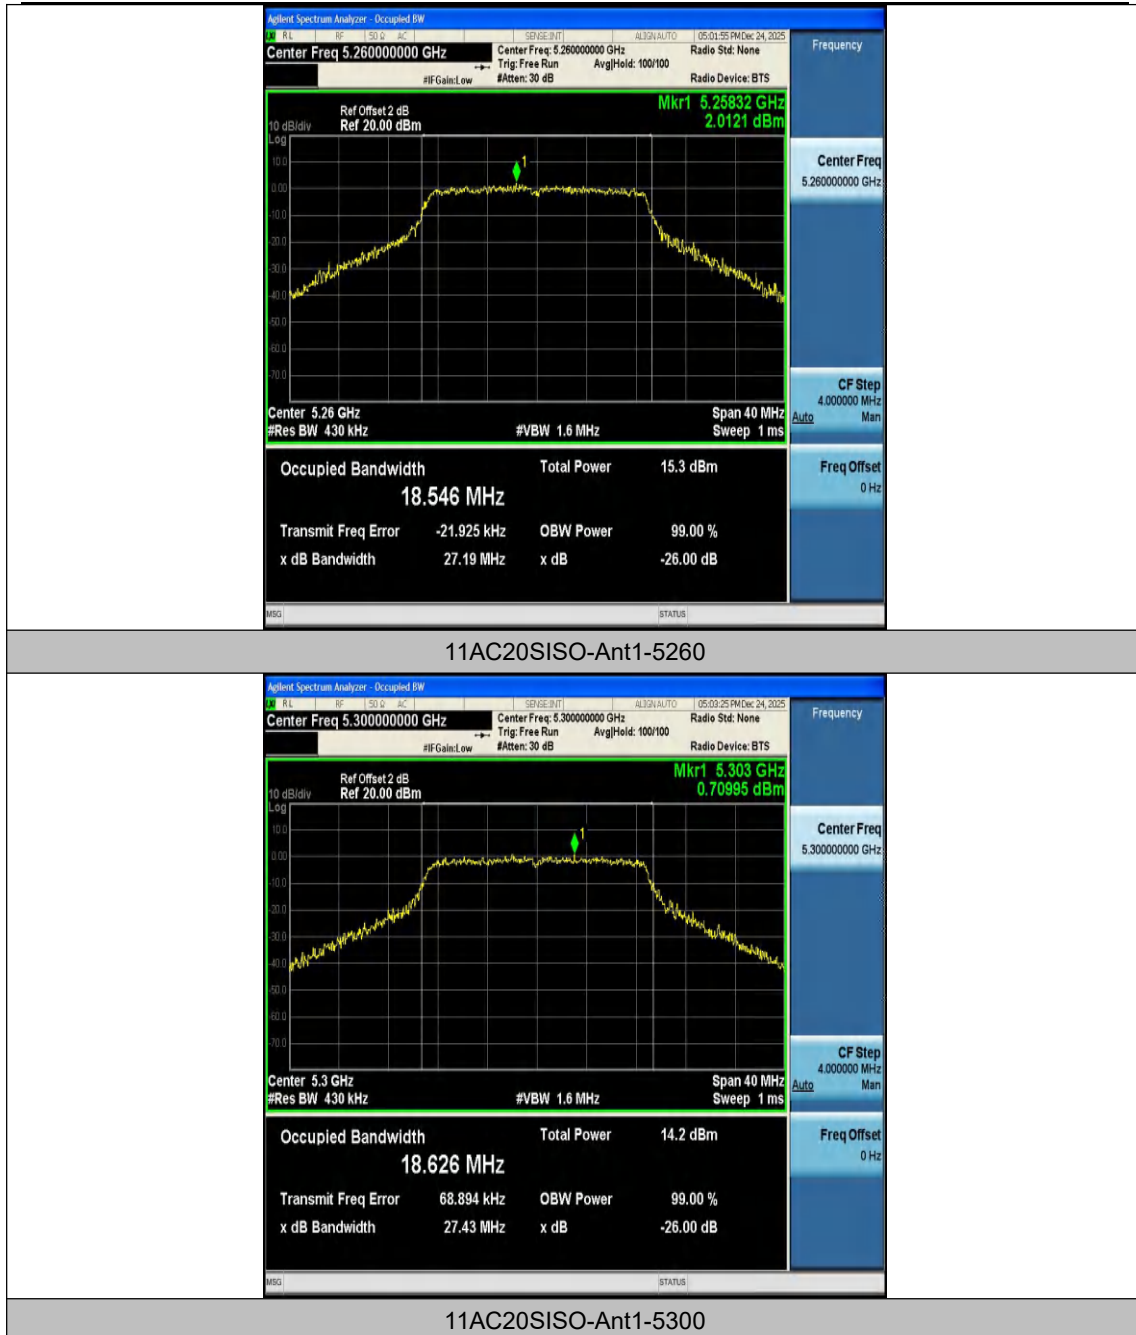

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com