



5MHz_Low_QPSK_1@0

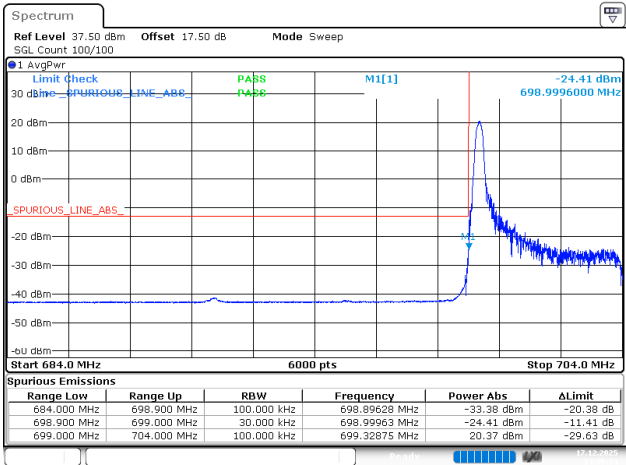


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 14:36:34

5MHz_Low_QPSK_25@0

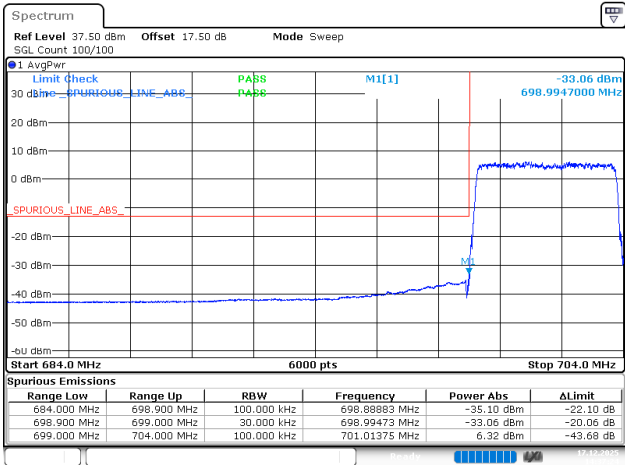


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 14:37:24

5MHz_Low_16QAM_1@0

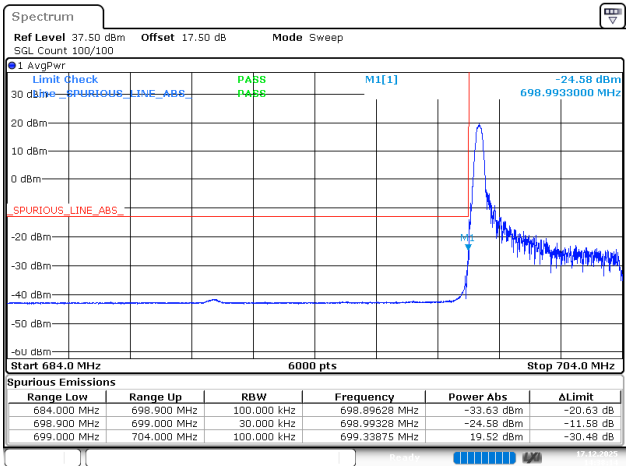


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 14:38:14

5MHz_Low_16QAM_25@0

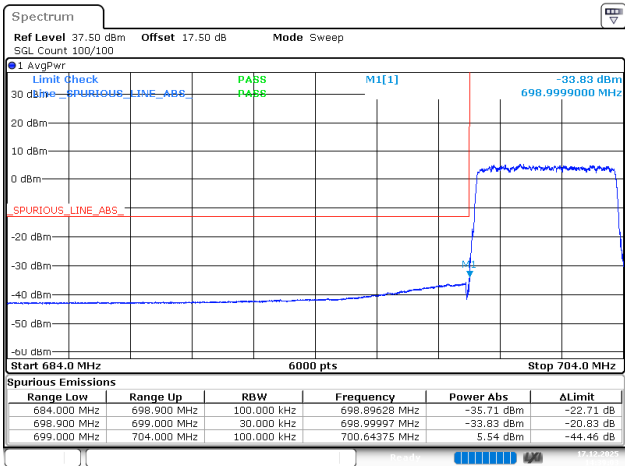


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 14:39:03

5MHz_High_QPSK_1@24

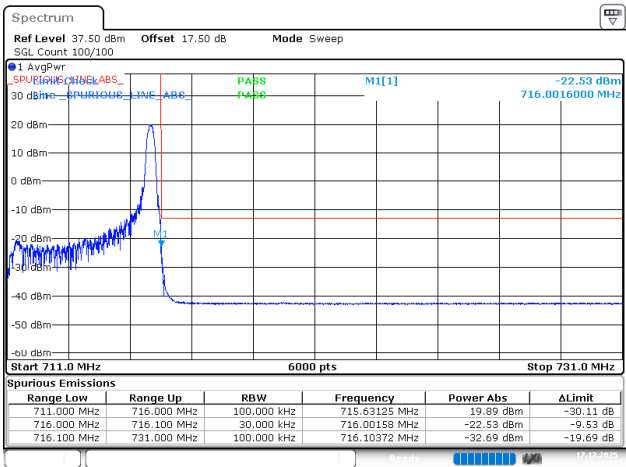


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 14:39:53

5MHz_High_QPSK_25@0

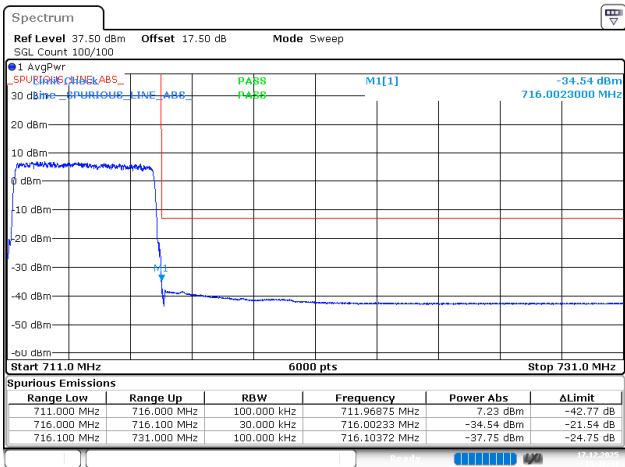


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 14:40:41

5MHz_High_16QAM_1@24

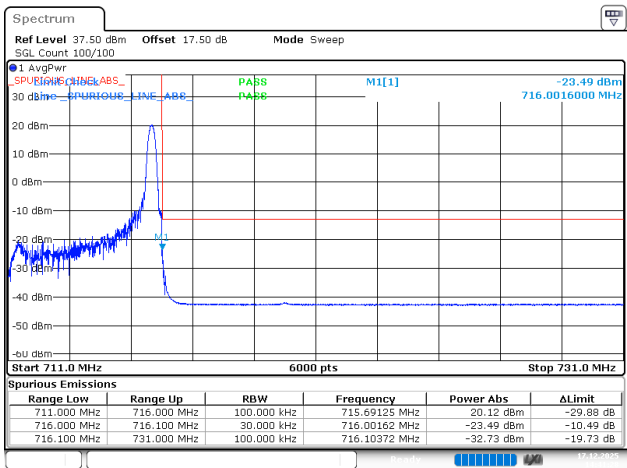


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 14:41:28

5MHz_High_16QAM_25@0

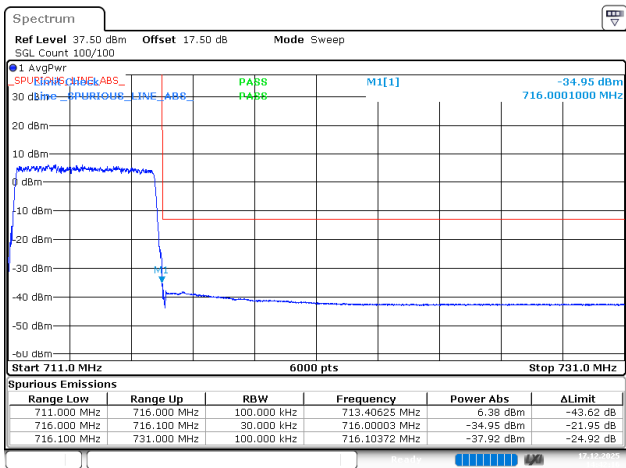


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 14:42:16

10MHz_Low_QPSK_1@0

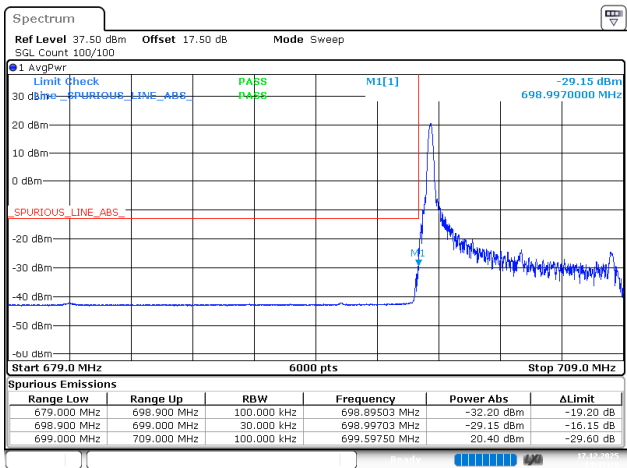


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 14:43:20

10MHz_Low_QPSK_50@0

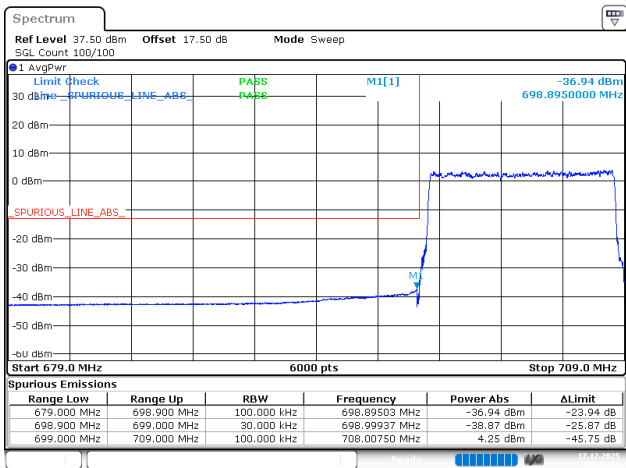


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:40:12

10MHz_Low_16QAM_1@0

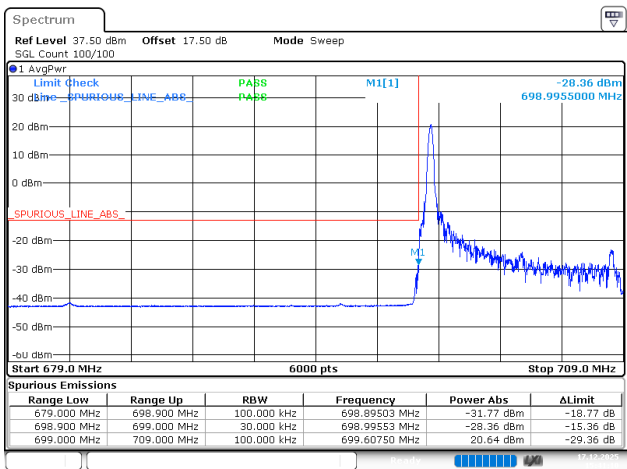


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:41:11

10MHz_Low_16QAM_50@0

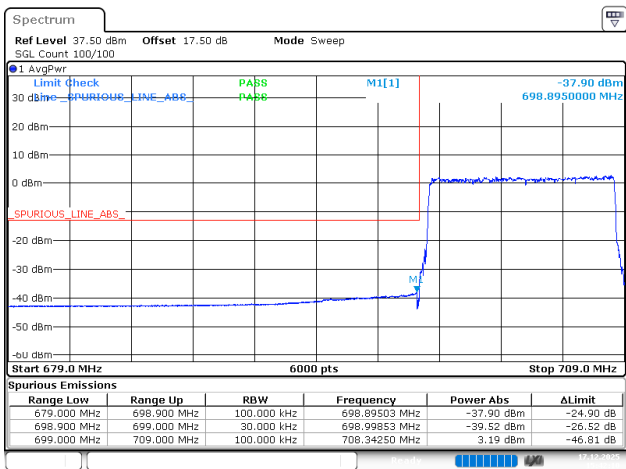


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:42:11

10MHz_High_QPSK_1@49

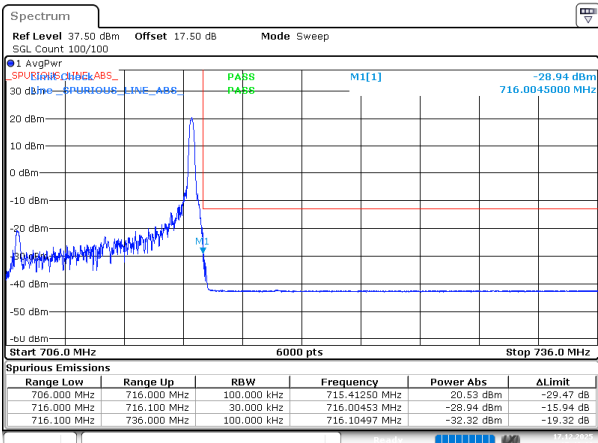


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:43:13

10MHz_High_QPSK_50@0

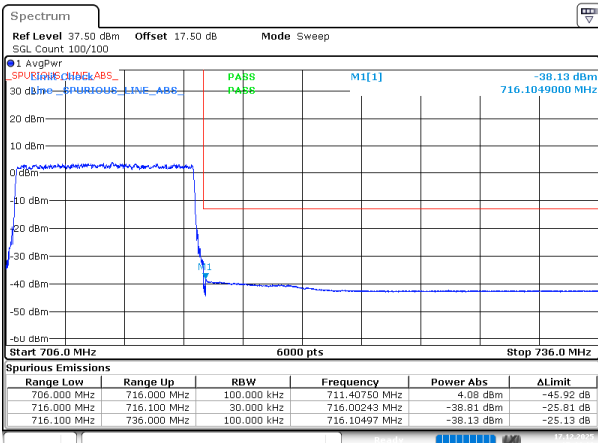


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:44:14

10MHz_High_16QAM_1@49

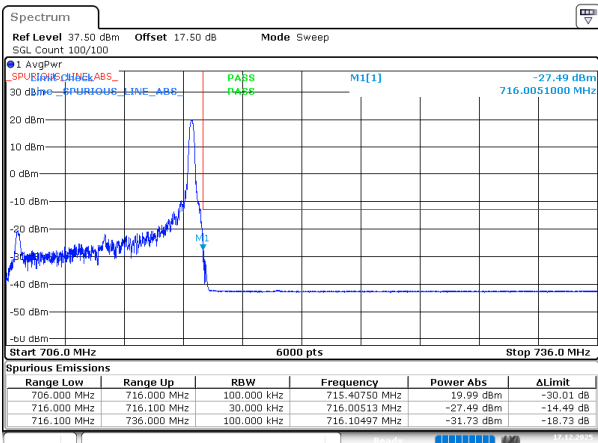

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:45:13


10MHz_High_16QAM_50@0

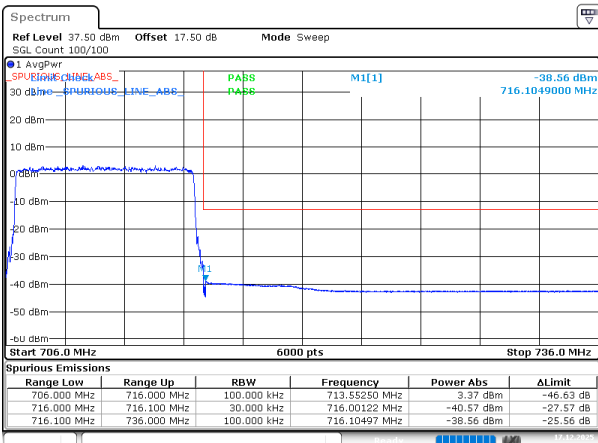

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:46:13


FCC Part 27 & IC RSS-130
LTE Band 17, Normal

5MHz_Low_QPSK_1@0

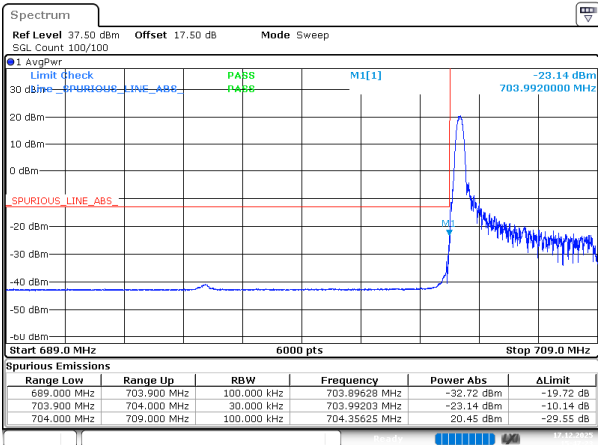


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:47:24

5MHz_Low_QPSK_25@0

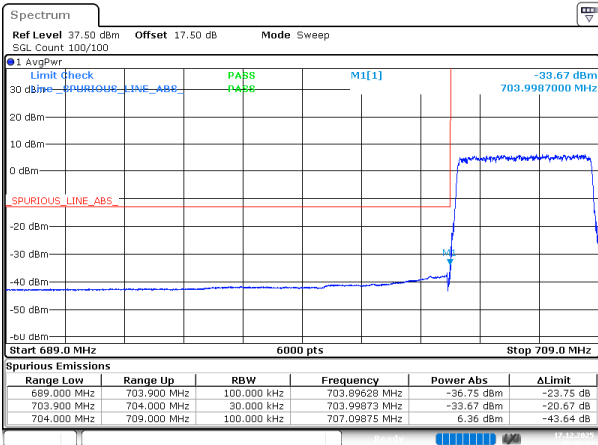


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:48:13

5MHz_Low_16QAM_1@0

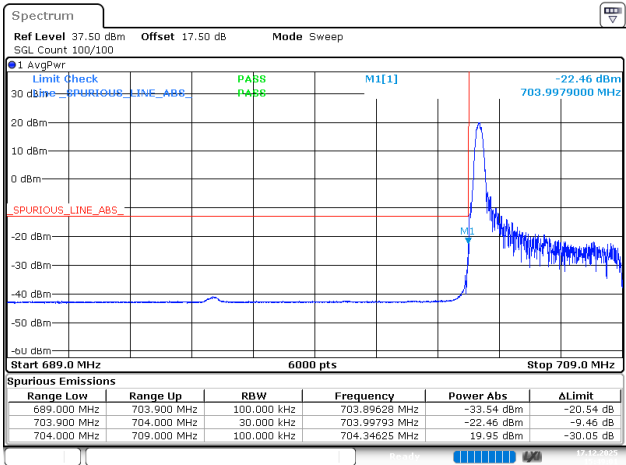


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:49:02

5MHz_Low_16QAM_25@0

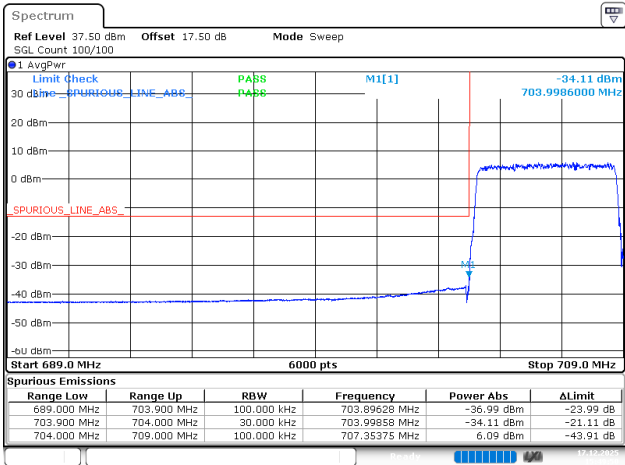


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:49:50

5MHz_High_QPSK_1@24

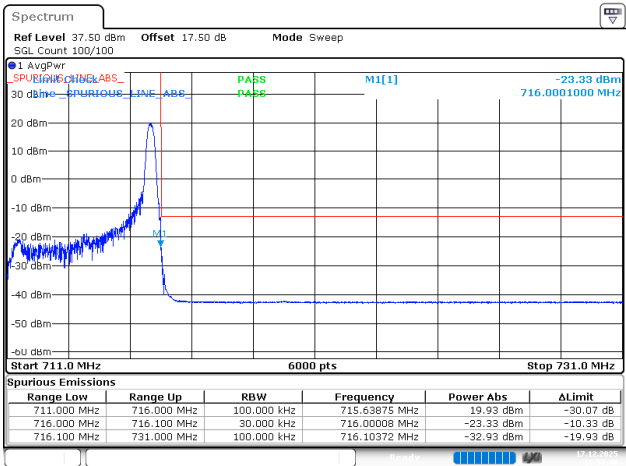


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:50:40

5MHz_High_QPSK_25@0

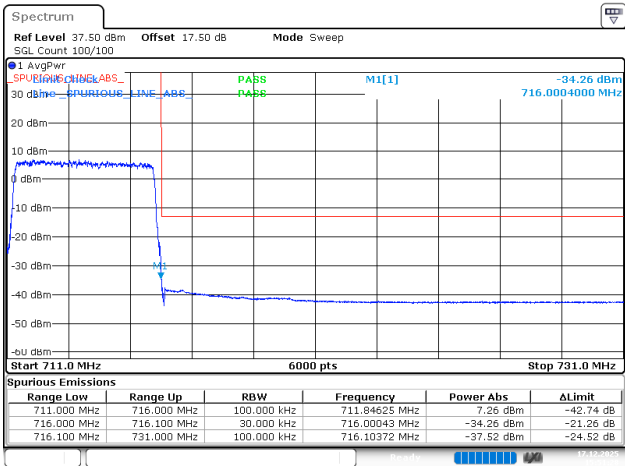


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:51:29

5MHz_High_16QAM_1@24

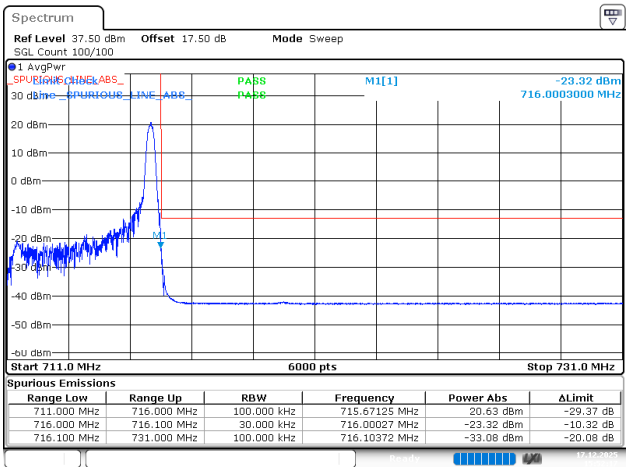


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:52:18

5MHz_High_16QAM_25@0

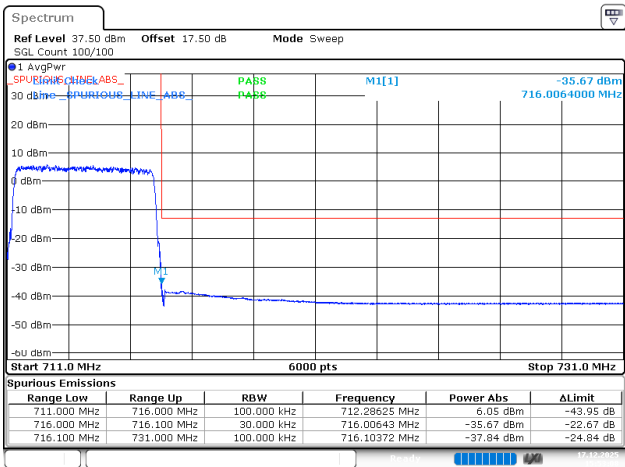


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:53:08

10MHz_Low_QPSK_1@0

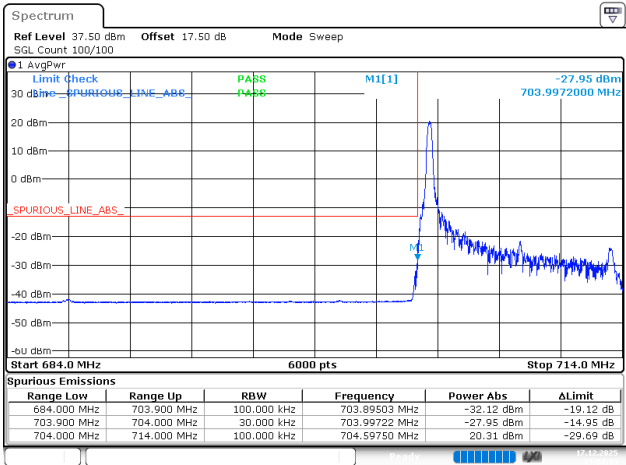


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:54:13

10MHz_Low_QPSK_50@0

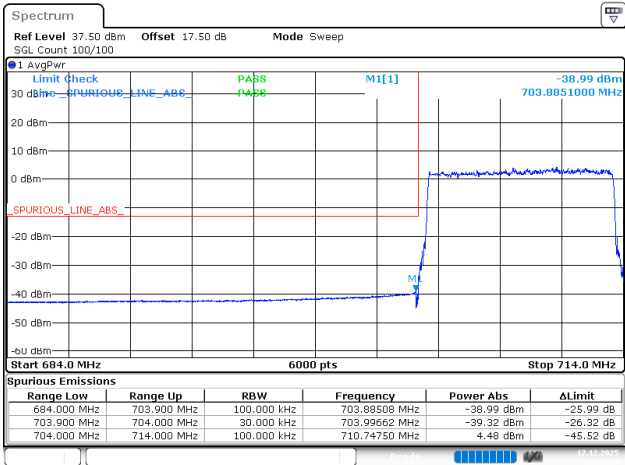


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:55:15

10MHz_Low_16QAM_1@0

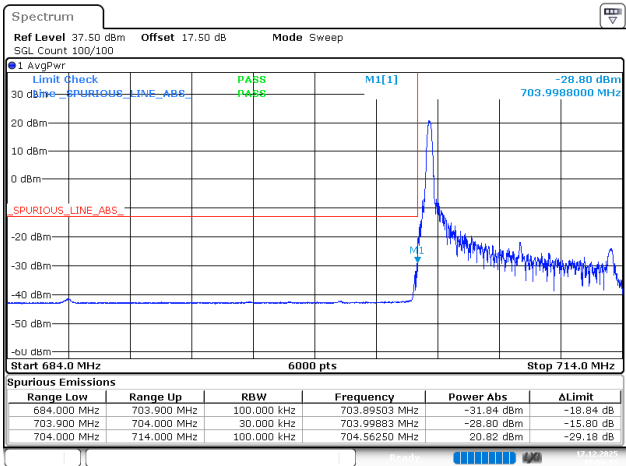


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:56:16

10MHz_Low_16QAM_50@0

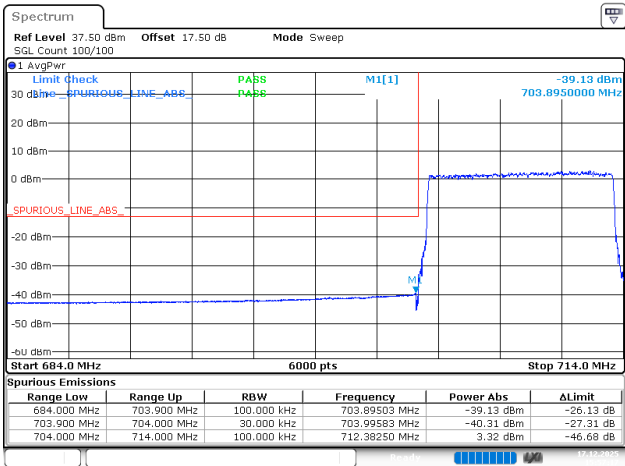


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:57:18

10MHz_High_QPSK_1@49

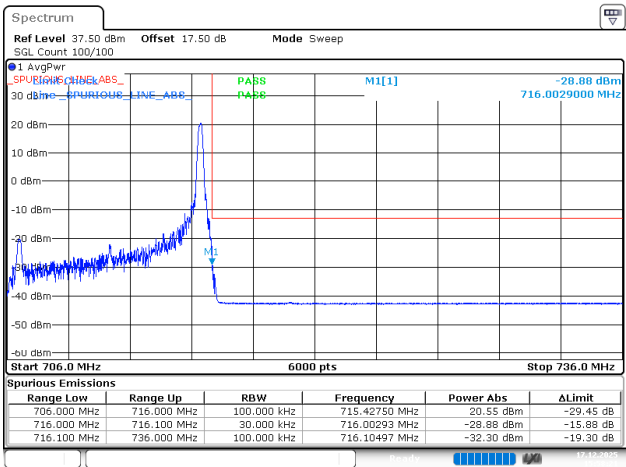


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:58:22

10MHz_High_QPSK_50@0

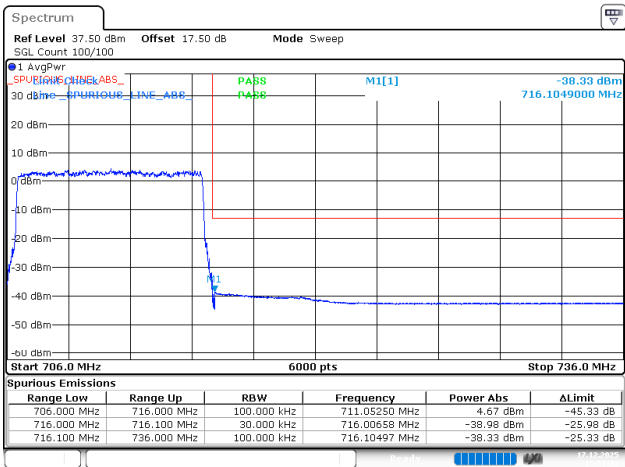


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 15:59:23

10MHz_High_16QAM_1@49

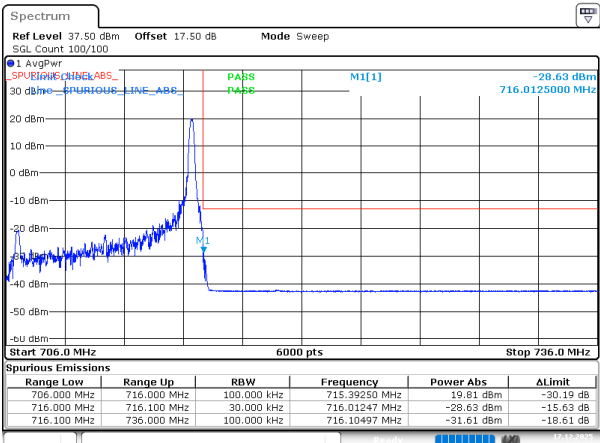

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 16:00:23


10MHz_High_16QAM_50@0

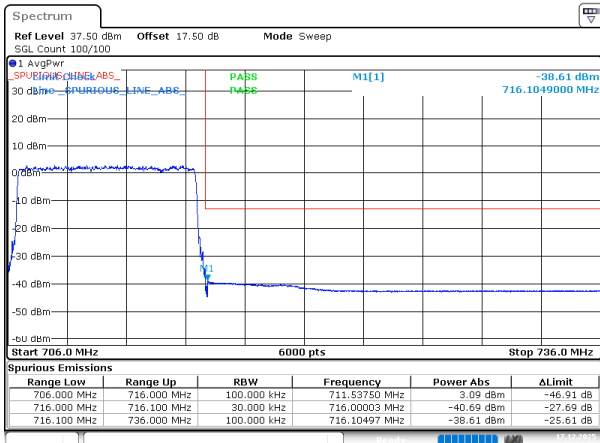

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 16:01:23


FCC Part 27 & IC RSS-139
LTE Band 66, Normal

1.4MHz_Low_QPSK_1@0

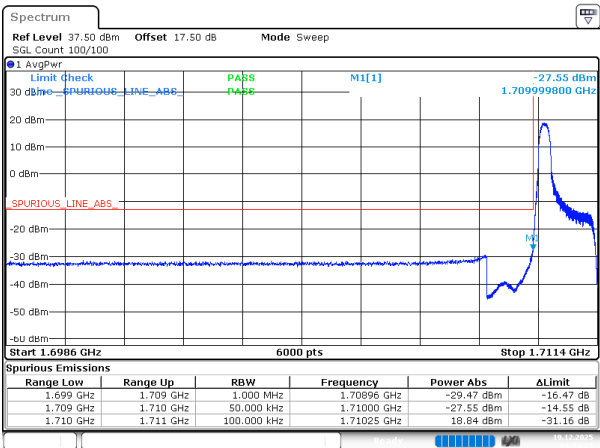


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:54:23

1.4MHz_Low_QPSK_6@0

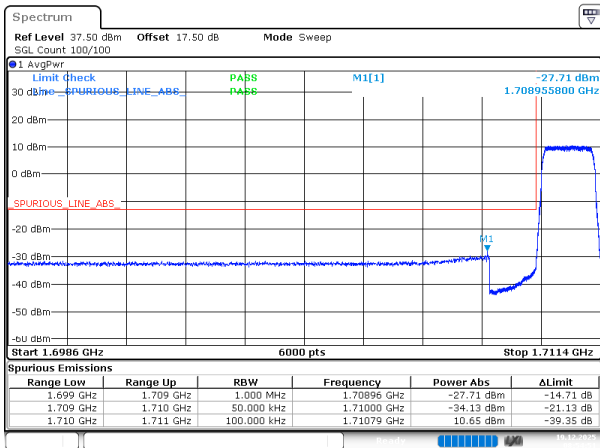


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:54:51

1.4MHz_Low_16QAM_1@0

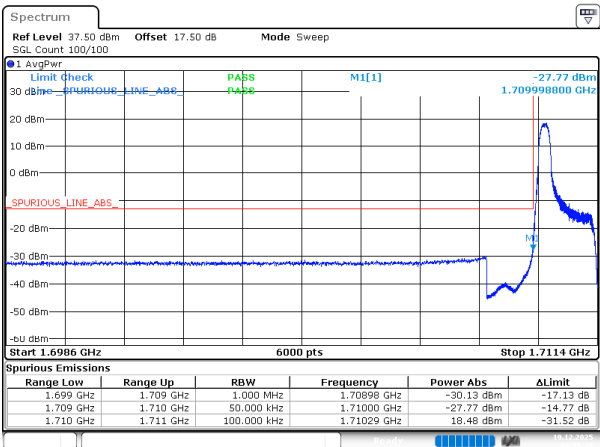


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:55:19

1.4MHz_Low_16QAM_6@0

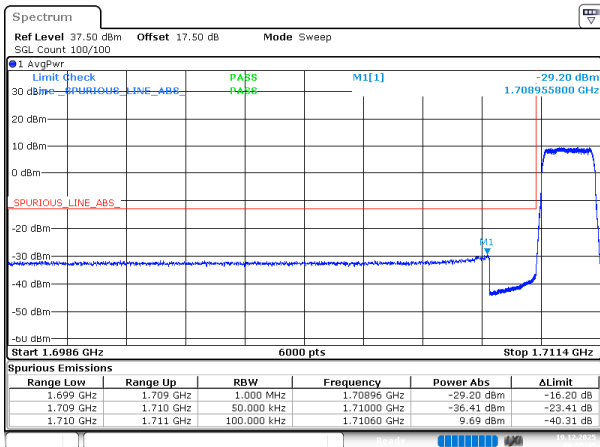


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:55:46

1.4MHz_High_QPSK_1@5

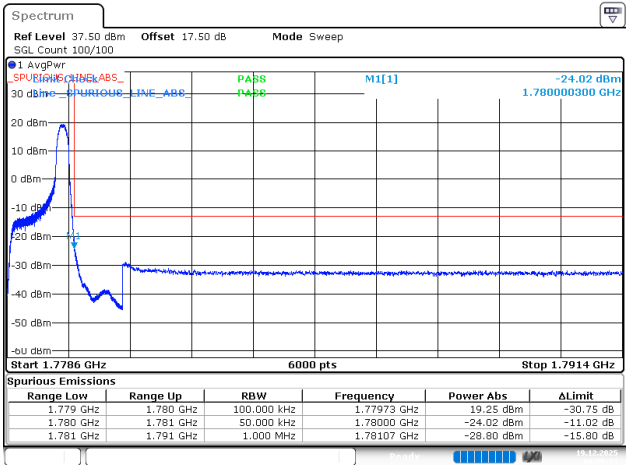


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:56:13

1.4MHz_High_QPSK_6@0

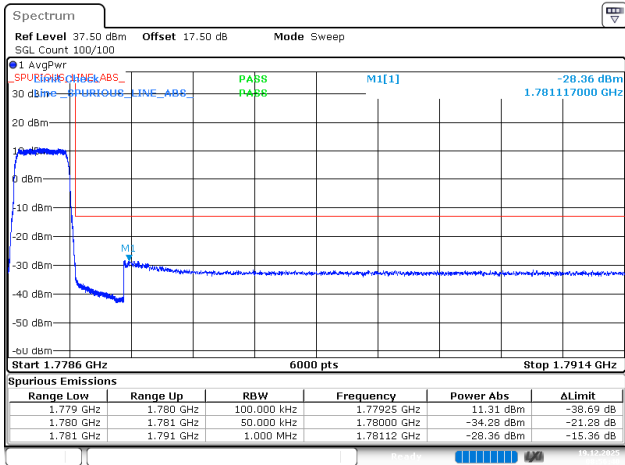


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:56:40

1.4MHz_High_16QAM_1@5

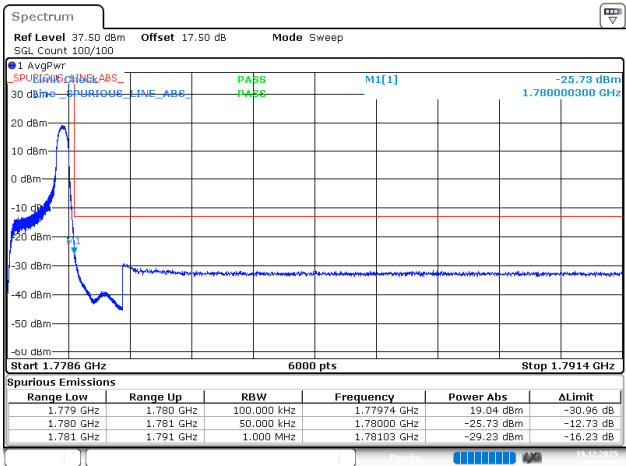


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:57:08

1.4MHz_High_16QAM_6@0

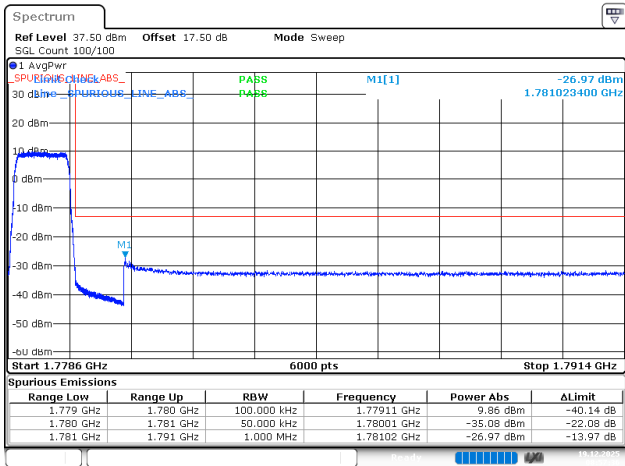


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:57:37

3MHz_Low_QPSK_1@0

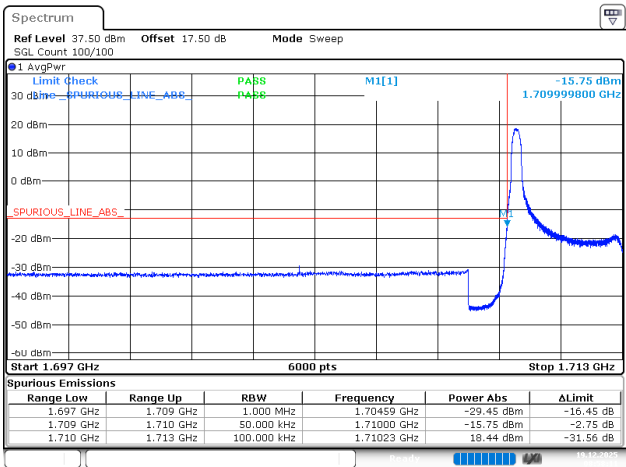


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:58:11

3MHz_Low_QPSK_15@0

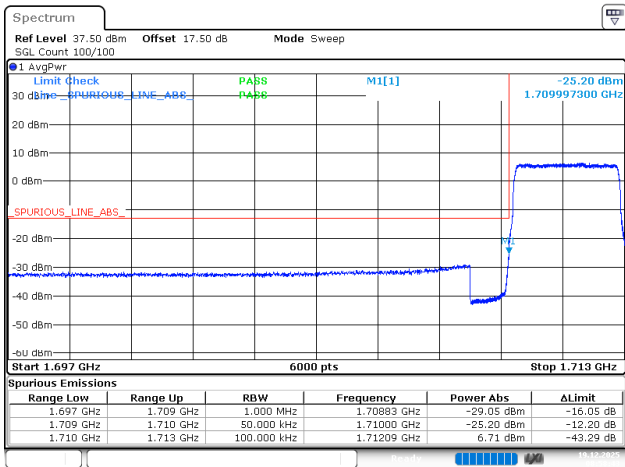


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:58:43

3MHz_Low_16QAM_1@0

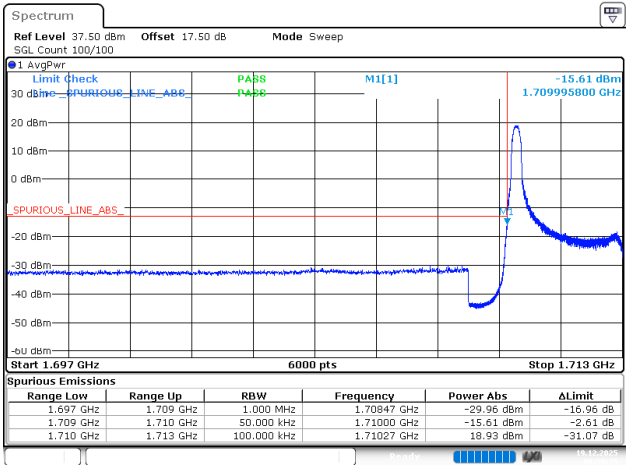


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:59:15

3MHz_Low_16QAM_15@0

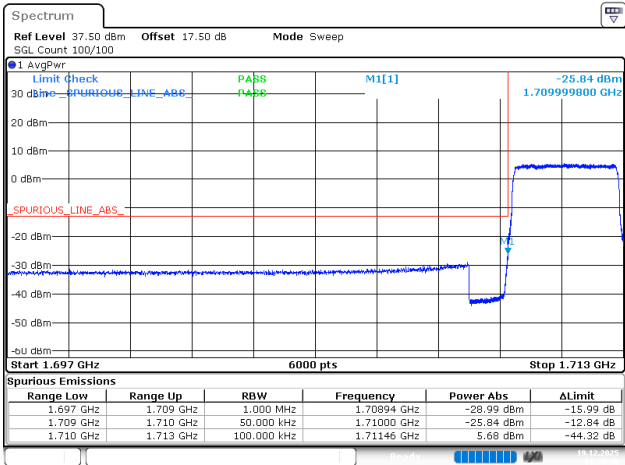


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:59:48

3MHz_High_QPSK_1@14

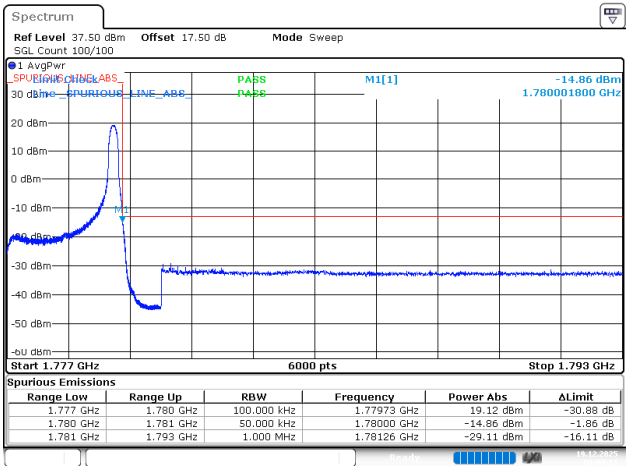


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:00:21

3MHz_High_QPSK_15@0

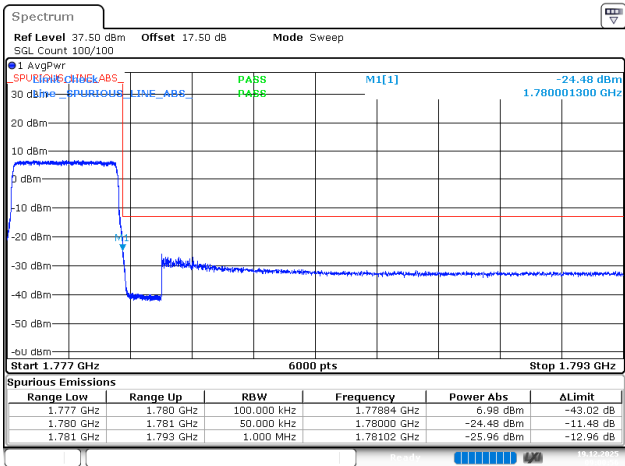


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:00:56

3MHz_High_16QAM_1@14

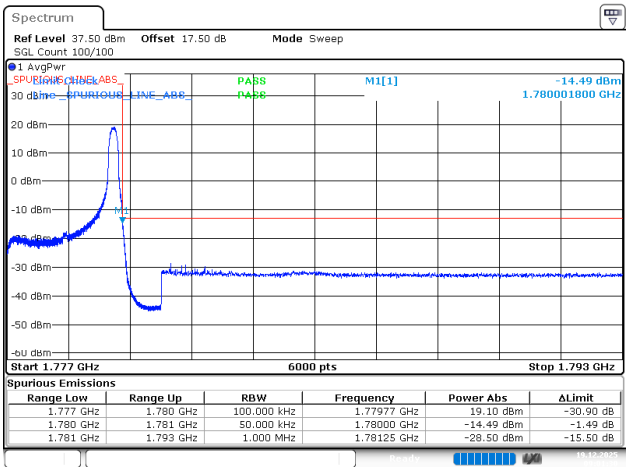


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:01:30

3MHz_High_16QAM_15@0

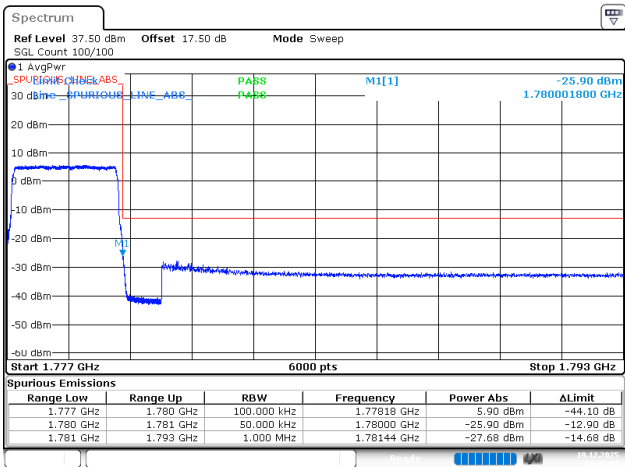


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:02:04

5MHz_Low_QPSK_1@0

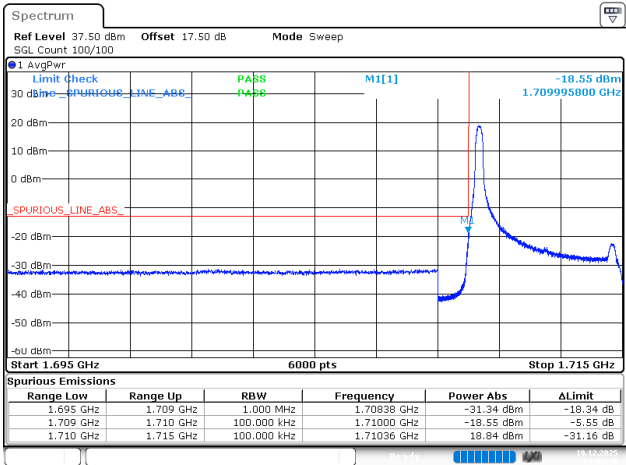


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:02:38

5MHz_Low_QPSK_25@0

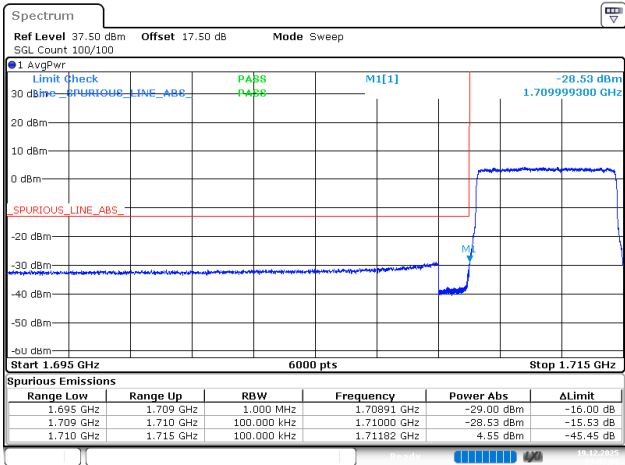


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:03:08

5MHz_Low_16QAM_1@0

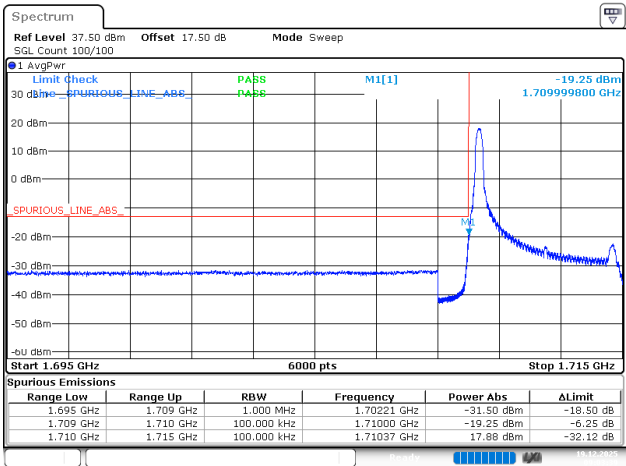


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:03:19

5MHz_Low_16QAM_25@0

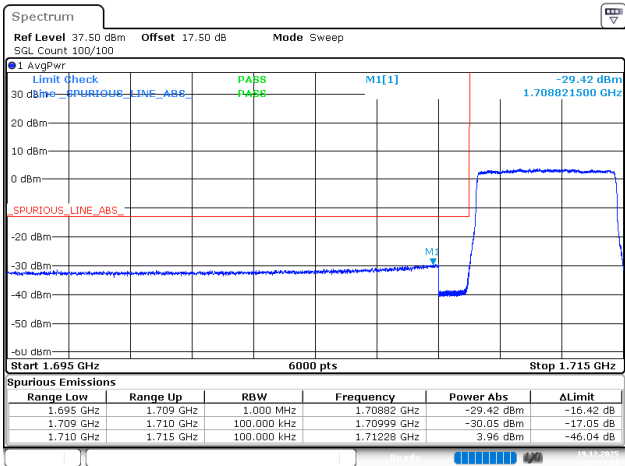


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:04:11

5MHz_High_QPSK_1@24

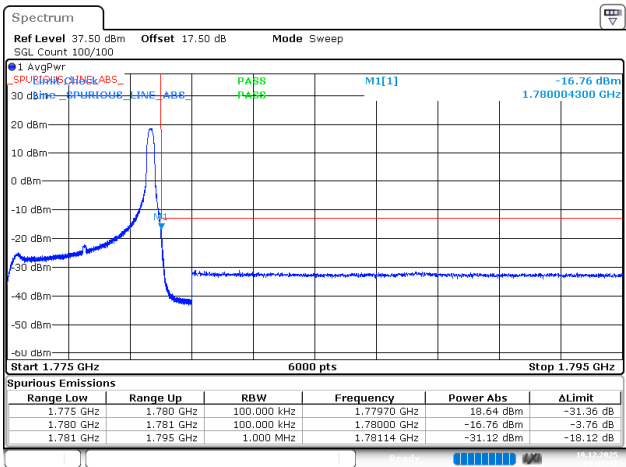


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:04:42

5MHz_High_QPSK_25@0

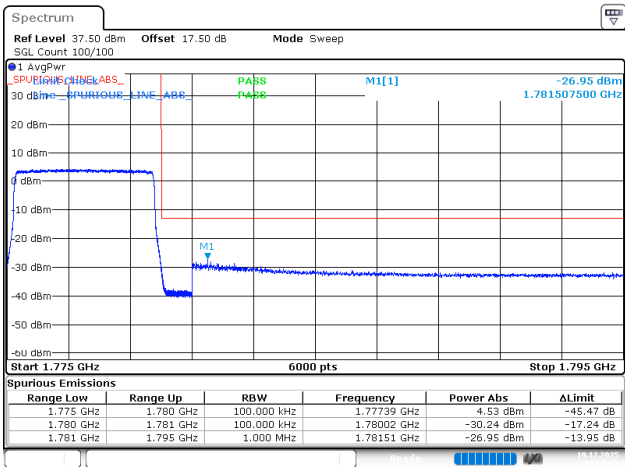


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:05:12

5MHz_High_16QAM_1@24

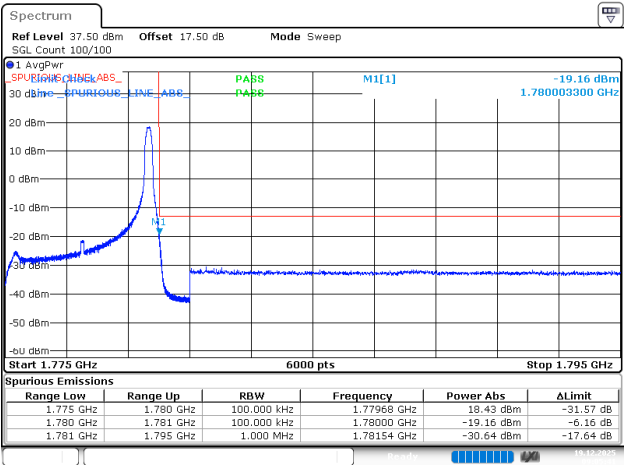


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:05:42

5MHz_High_16QAM_25@0

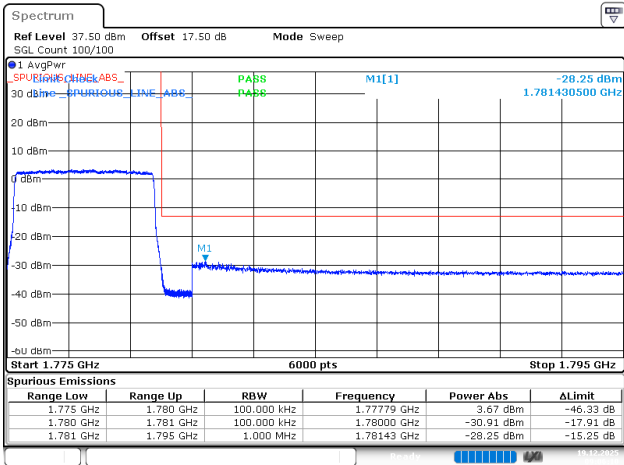


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:06:11

10MHz_Low_QPSK_1@0

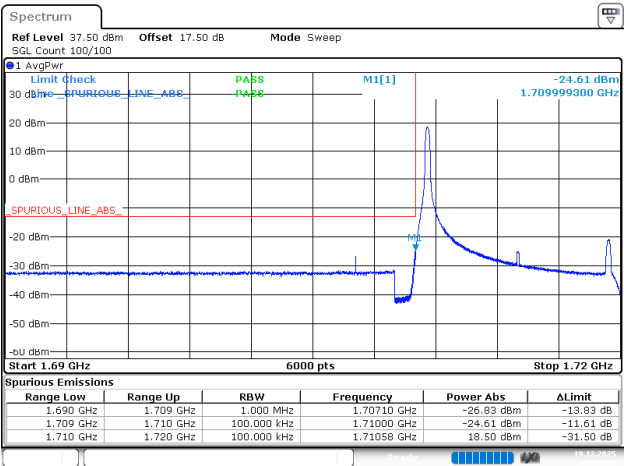


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:06:53

10MHz_Low_QPSK_50@0

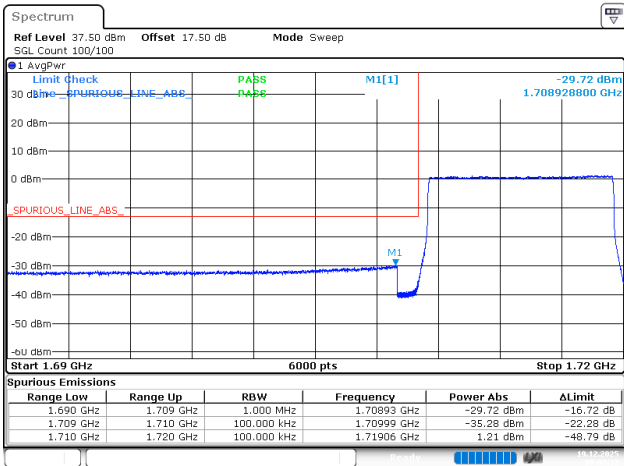


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:07:32

10MHz_Low_16QAM_1@0

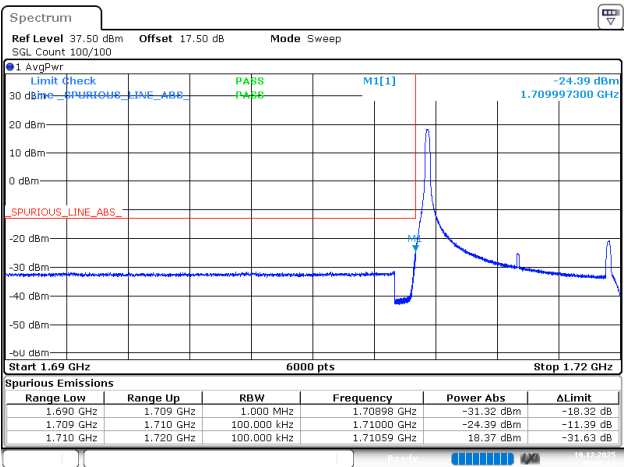


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:08:13

10MHz_Low_16QAM_50@0

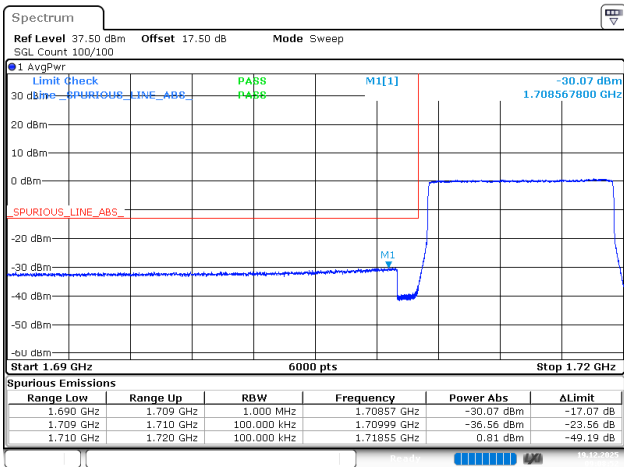


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:08:53

10MHz_High_QPSK_1@49

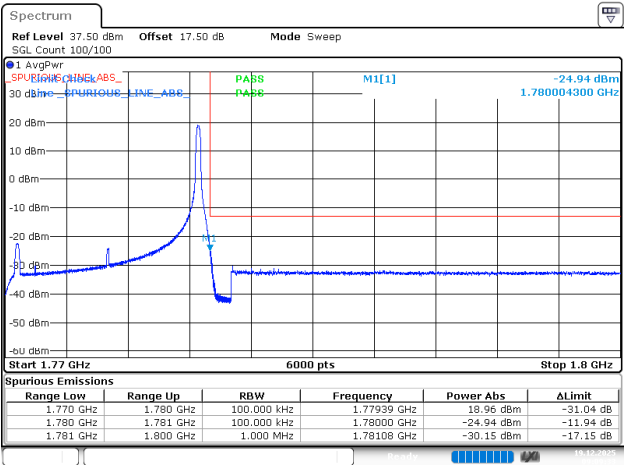


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:09:33

10MHz_High_QPSK_50@0

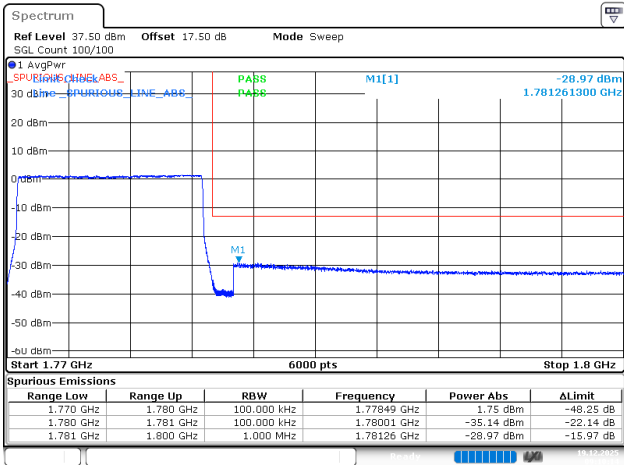


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:10:14

10MHz_High_16QAM_1@49

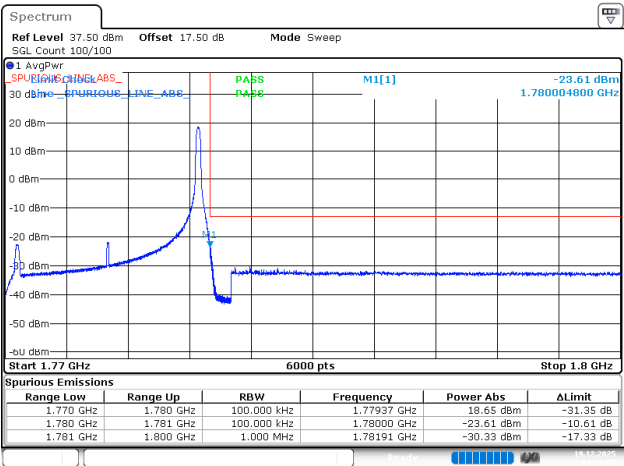


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:10:55

10MHz_High_16QAM_50@0

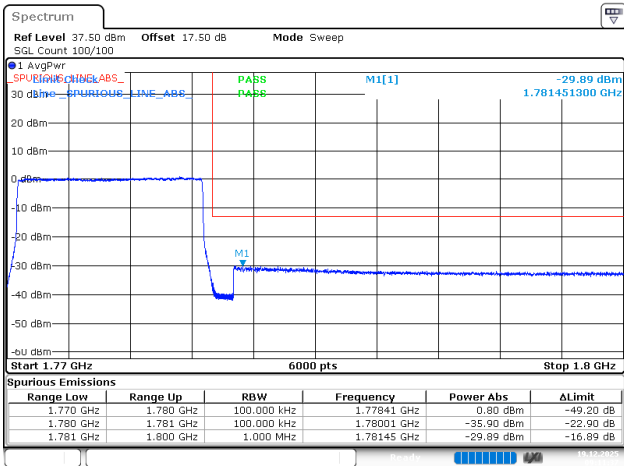


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:11:37

15MHz_Low_QPSK_1@0

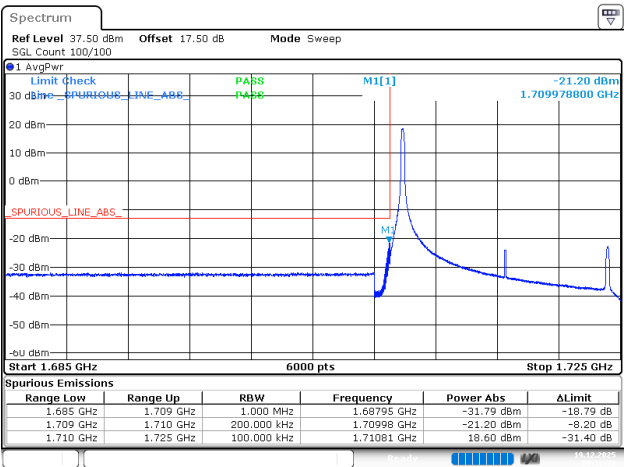


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:12:32

15MHz_Low_QPSK_75@0

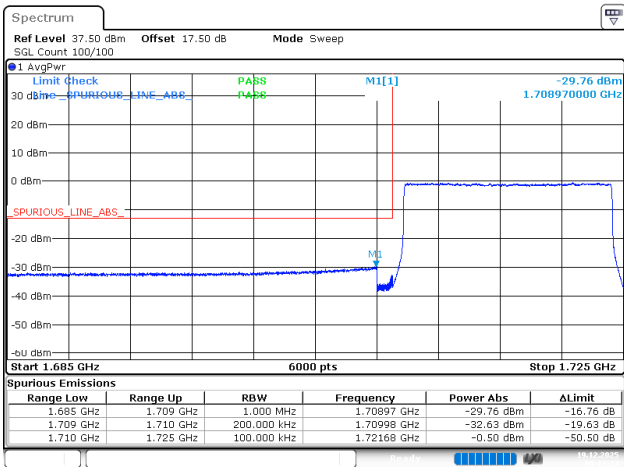


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:13:24

15MHz_Low_16QAM_1@0

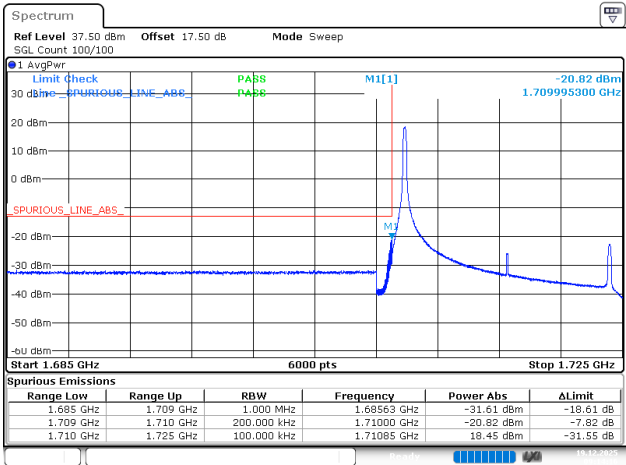


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:14:17

15MHz_Low_16QAM_75@0

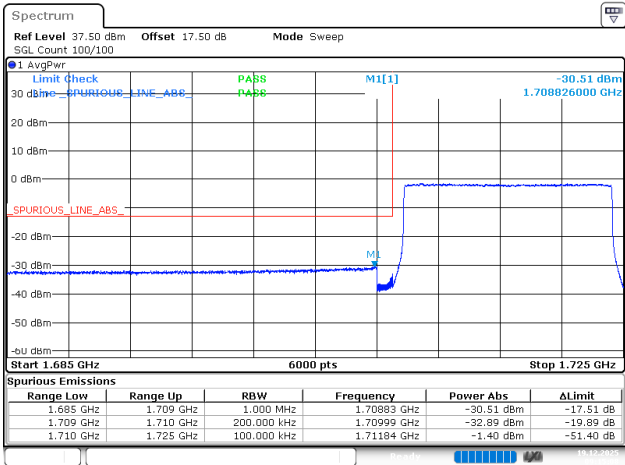


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:15:08

15MHz_High_QPSK_1@74

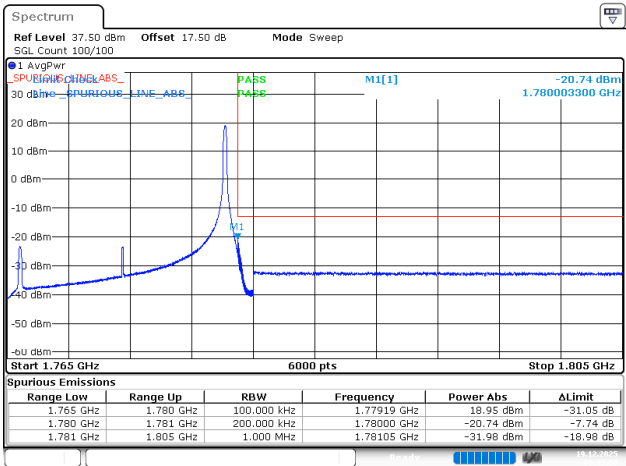


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:15:59

15MHz_High_QPSK_75@0

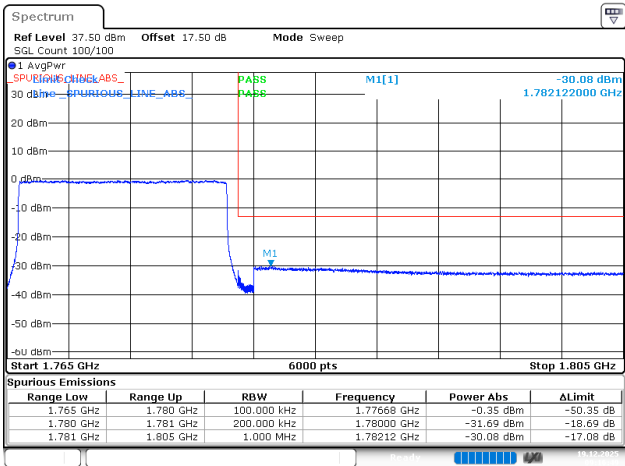


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:16:50

15MHz_High_16QAM_1@74

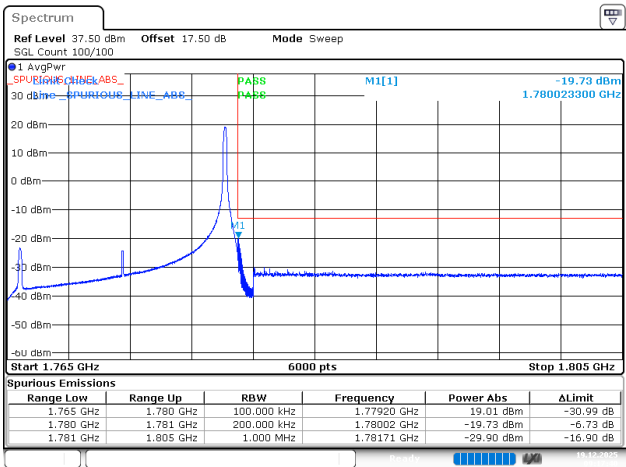


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:17:40

15MHz_High_16QAM_75@0

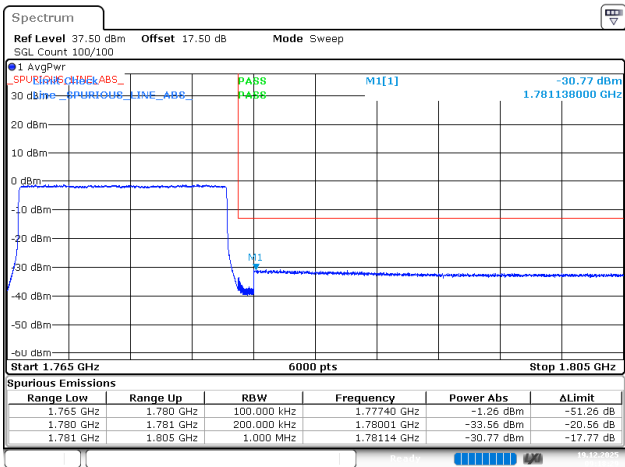


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:18:30

20MHz_Low_QPSK_1@0

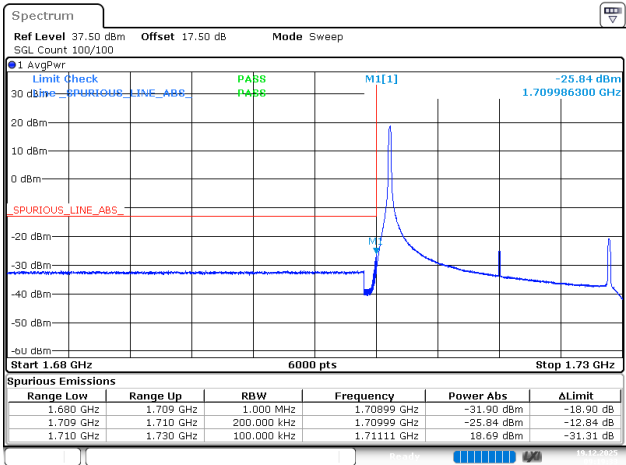


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:19:33

20MHz_Low_QPSK_100@0

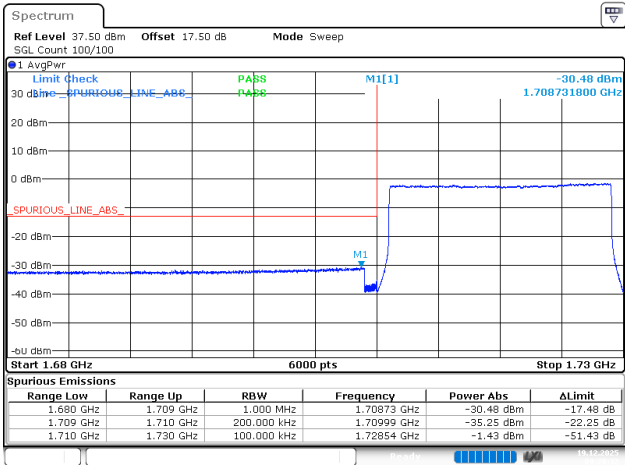


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:20:33

20MHz_Low_16QAM_1@0

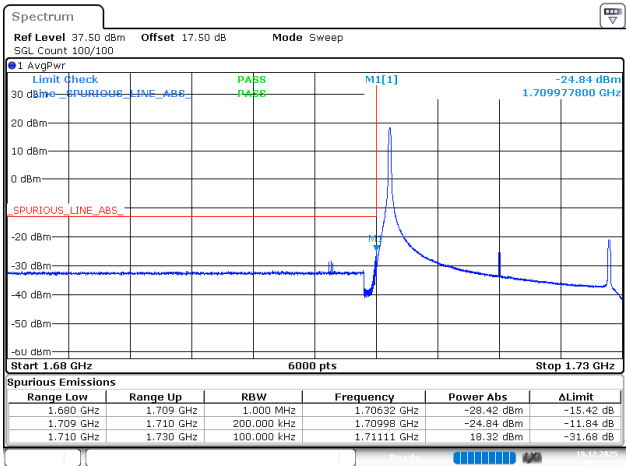


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:21:32

20MHz_Low_16QAM_100@0

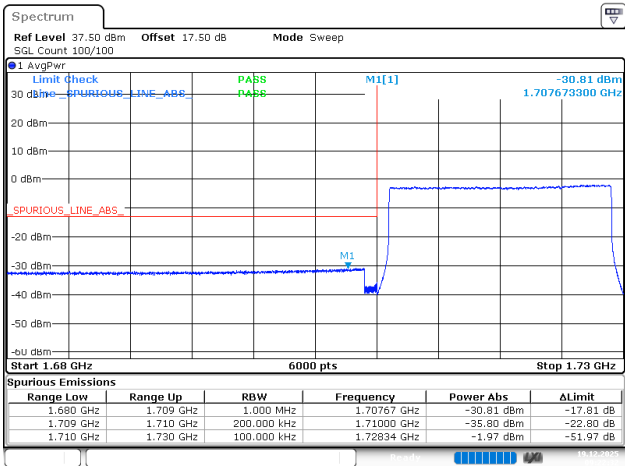


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:22:32

20MHz_High_QPSK_1@99

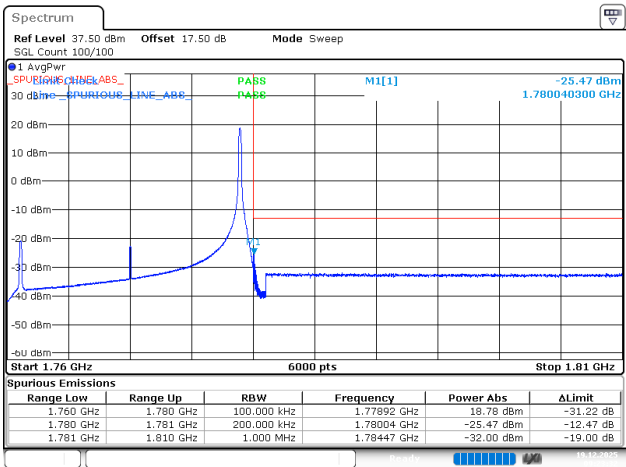


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:23:32

20MHz_High_QPSK_100@0

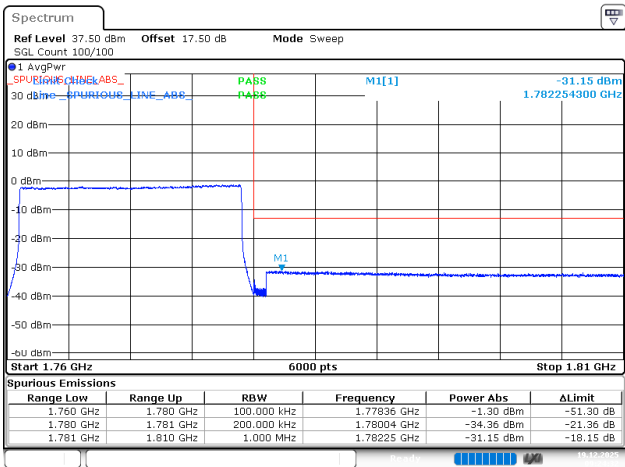


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:24:32

20MHz_High_16QAM_1@99

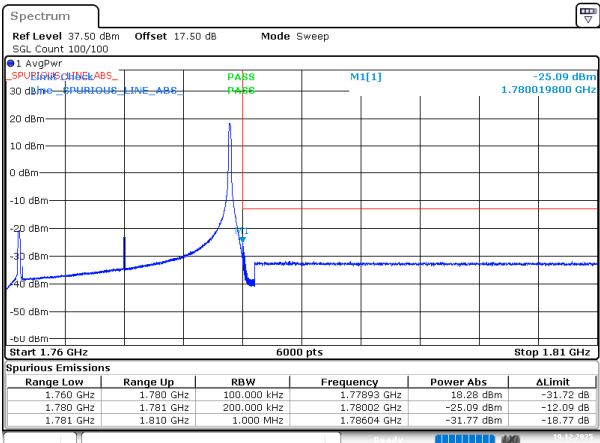

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:25:32


20MHz_High_16QAM_100@0

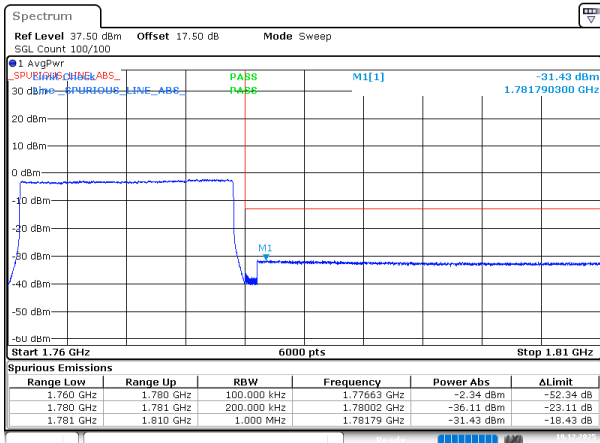

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:26:34


FCC Part 27 & IC RSS-130
LTE Band 71, Normal

5MHz_Low_QPSK_1@0

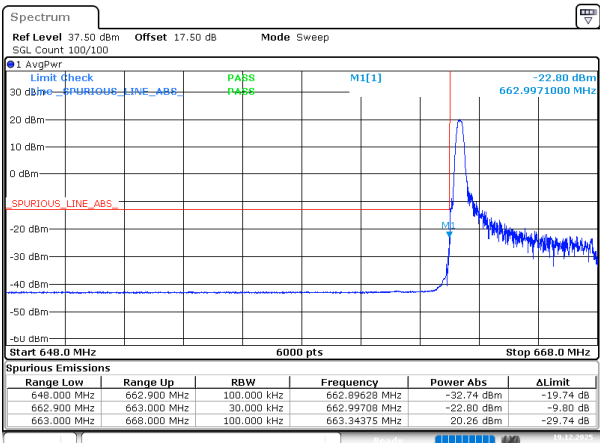


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:27:42

5MHz_Low_QPSK_25@0

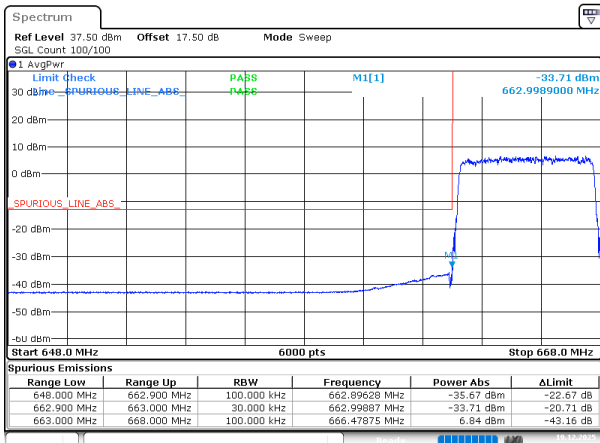


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:28:32

5MHz_Low_16QAM_1@0

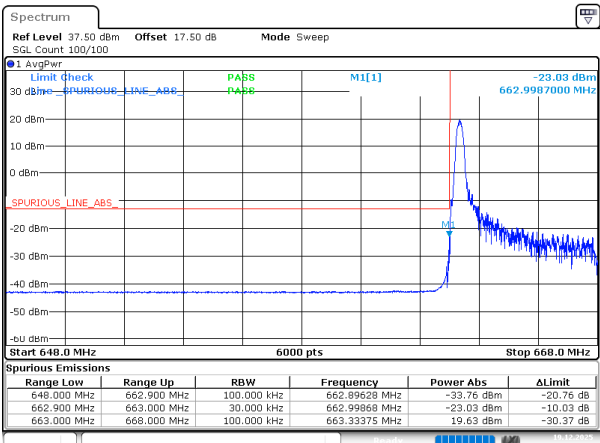


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:29:22

5MHz_Low_16QAM_25@0

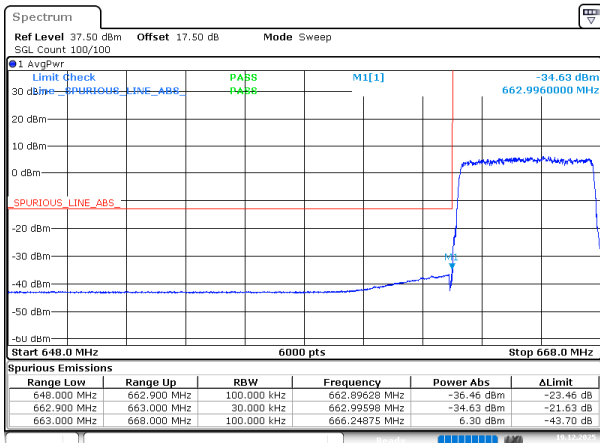


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:30:11

5MHz_High_QPSK_1@24

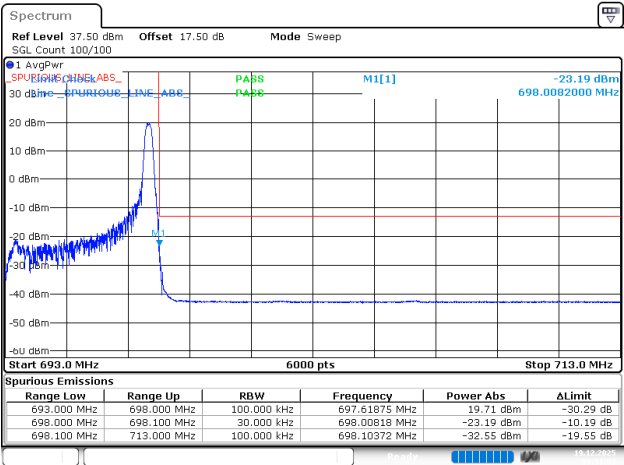


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:31:03

5MHz_High_QPSK_25@0

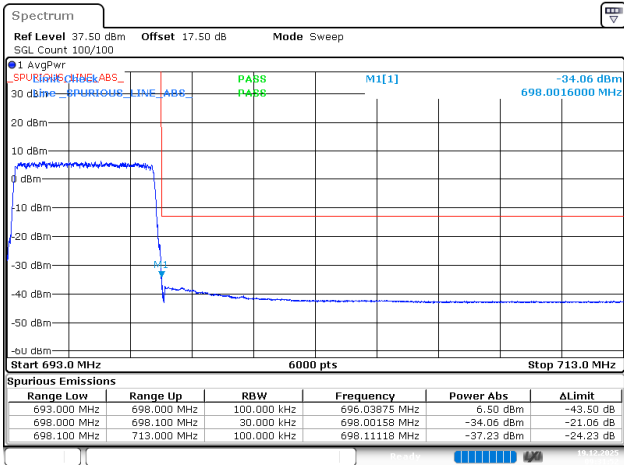


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:31:52

5MHz_High_16QAM_1@24

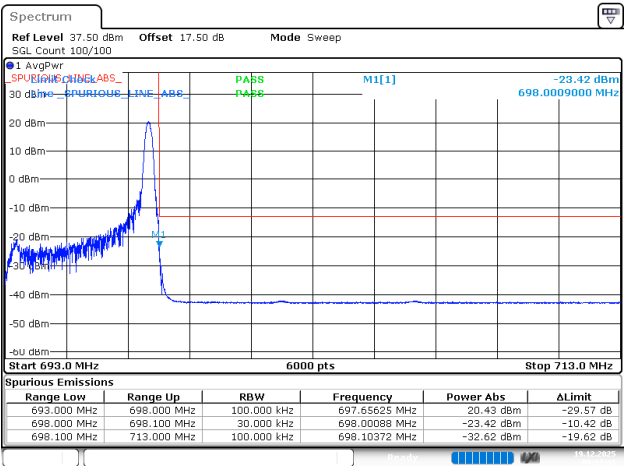


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:32:42

5MHz_High_16QAM_25@0

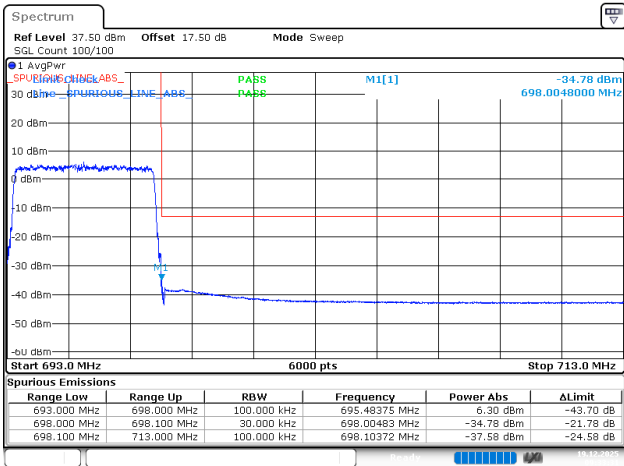


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:33:31

10MHz_Low_QPSK_1@0

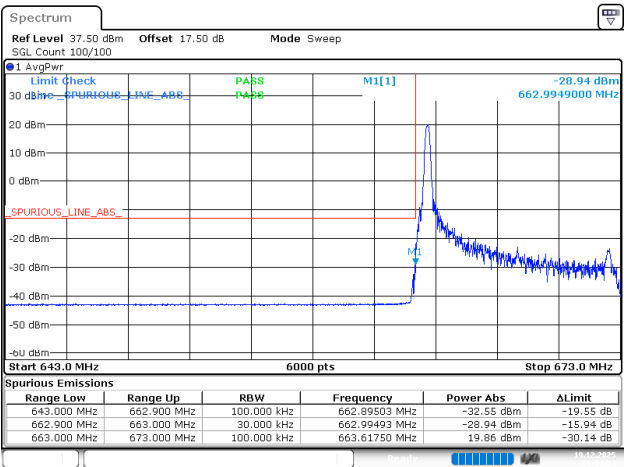


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:34:34

10MHz_Low_QPSK_50@0

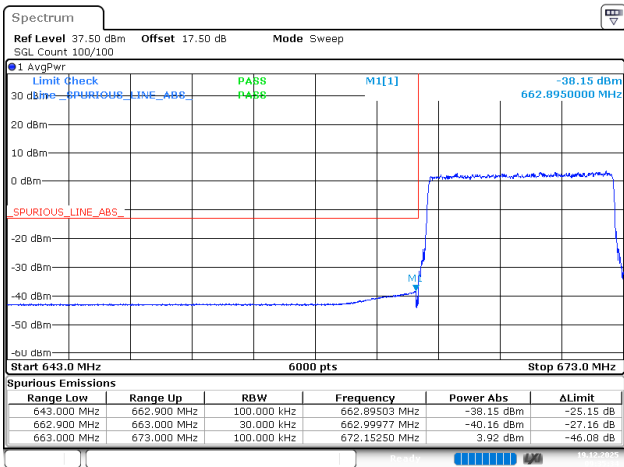


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:35:34

10MHz_Low_16QAM_1@0

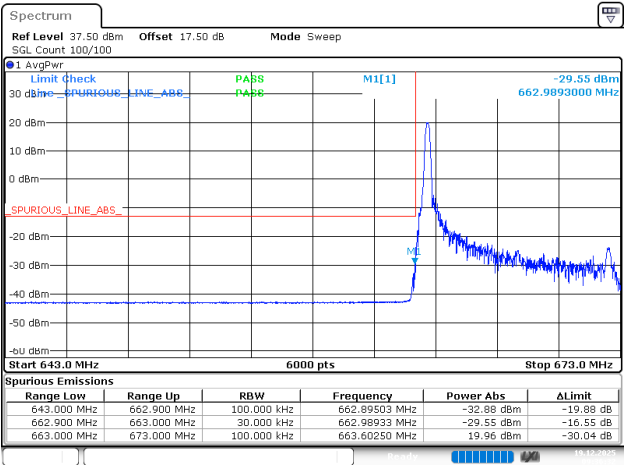


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:36:32

10MHz_Low_16QAM_50@0

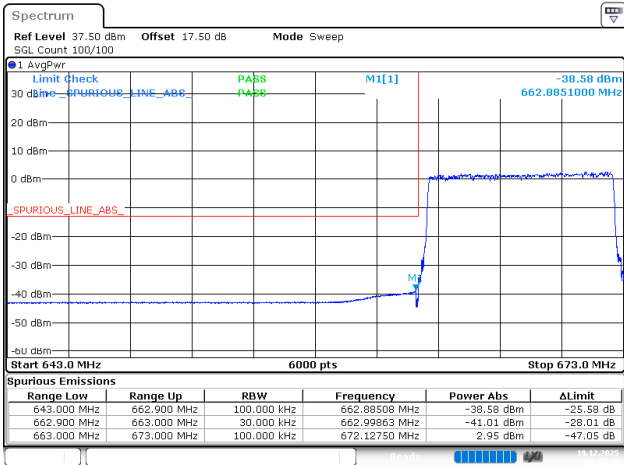


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:37:31

10MHz_High_QPSK_1@49

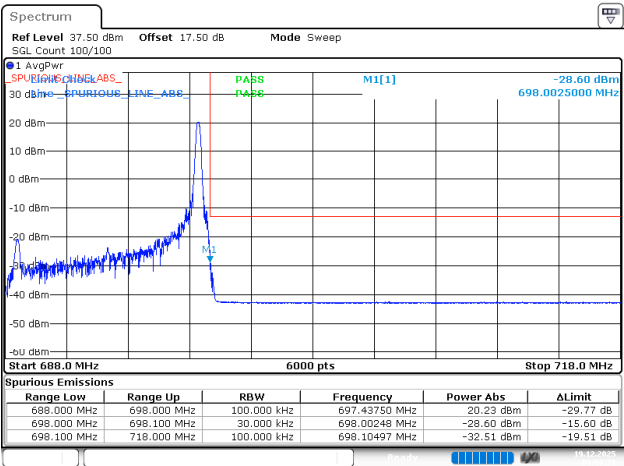


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:38:31

10MHz_High_QPSK_50@0

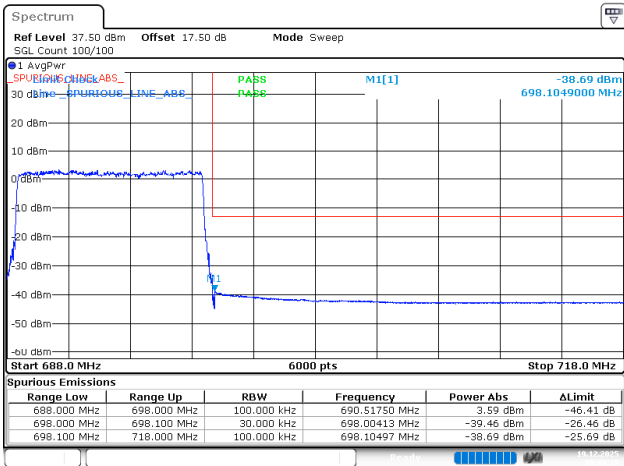


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:39:30

10MHz_High_16QAM_1@49

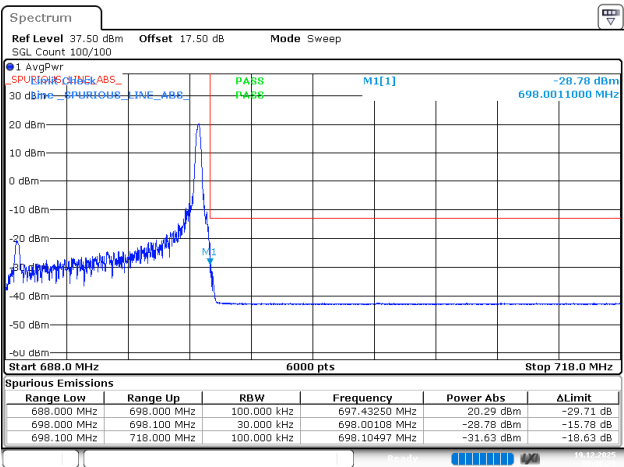


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:40:29

10MHz_High_16QAM_50@0

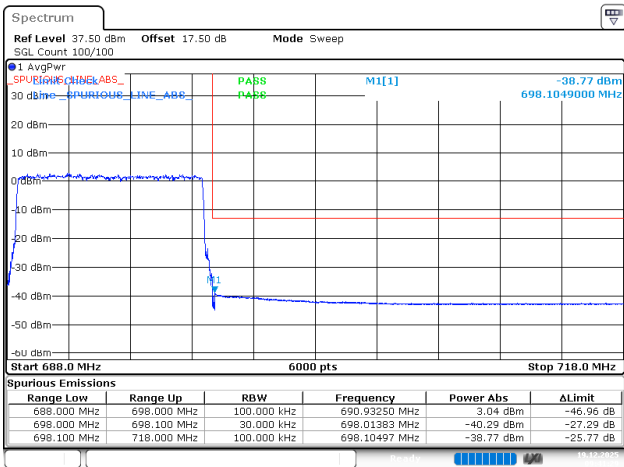


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:41:29

15MHz_Low_QPSK_1@0

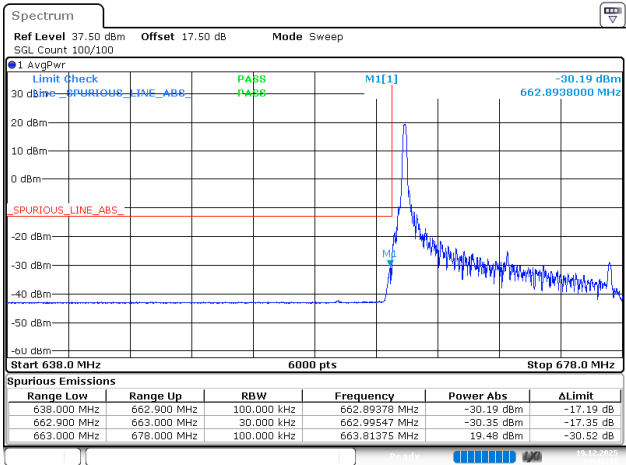


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:42:42

15MHz_Low_QPSK_75@0

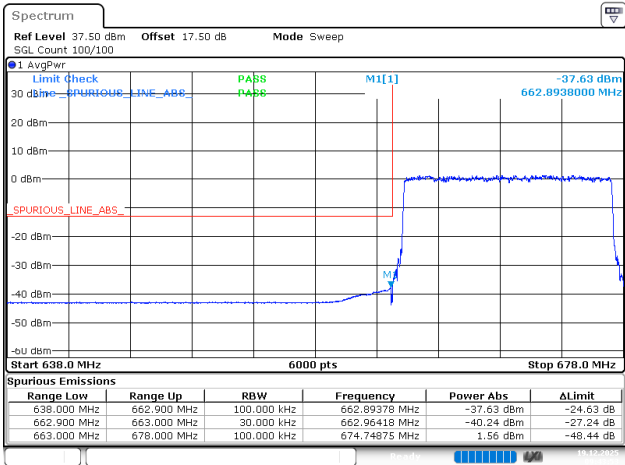


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:43:53

15MHz_Low_16QAM_1@0

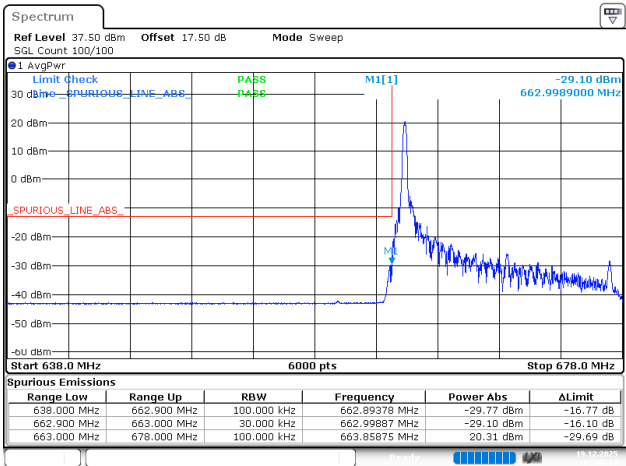


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:45:05

15MHz_Low_16QAM_75@0

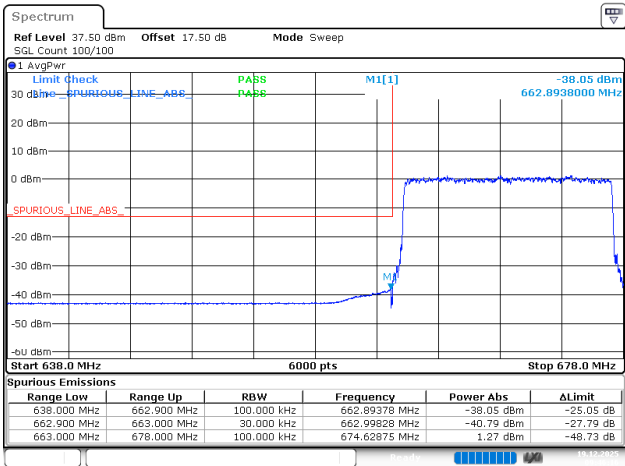


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:46:16

15MHz_High_QPSK_1@74

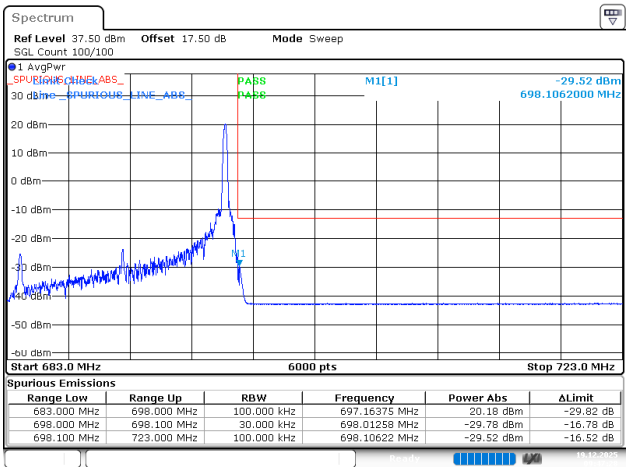


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:47:28

15MHz_High_QPSK_75@0

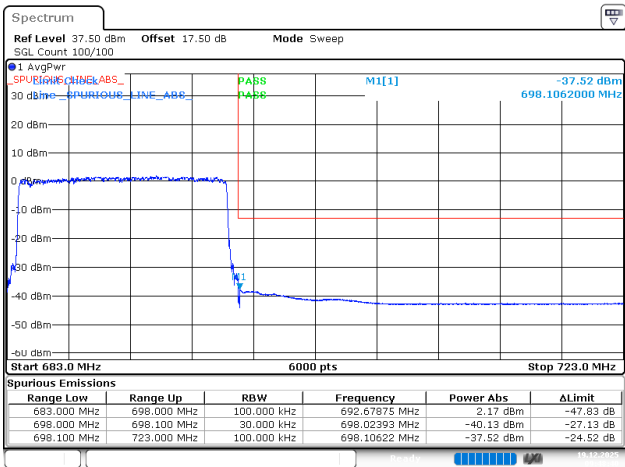


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:48:40

15MHz_High_16QAM_1@74

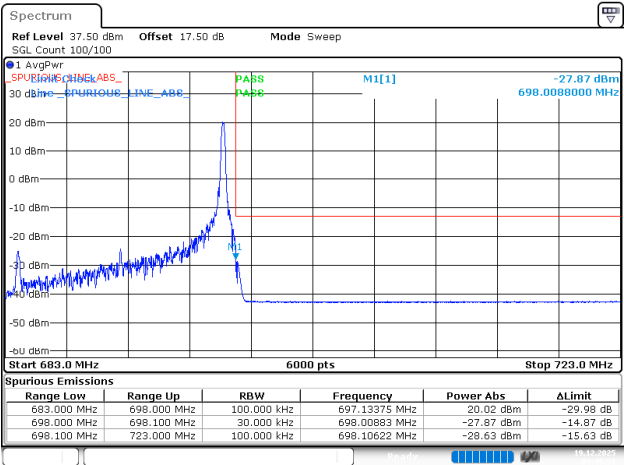


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:49:51

15MHz_High_16QAM_75@0

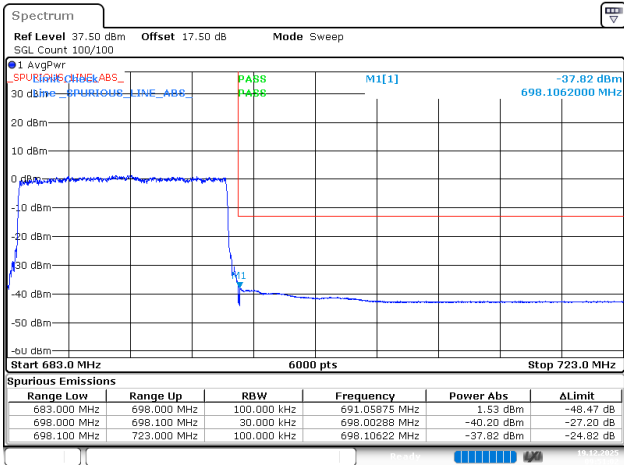


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:51:02

20MHz_Low_QPSK_1@0

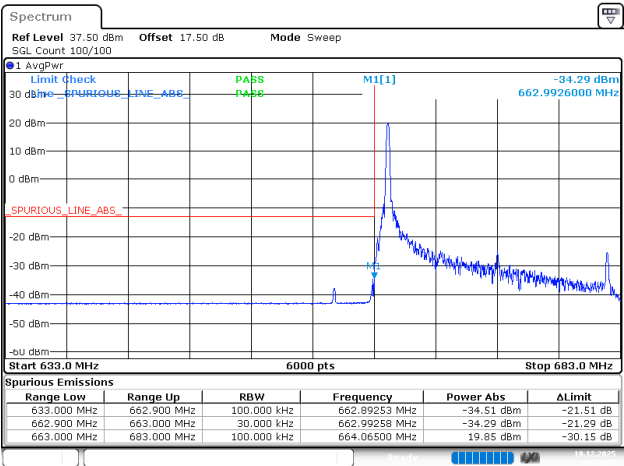


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:52:25

20MHz_Low_QPSK_100@0

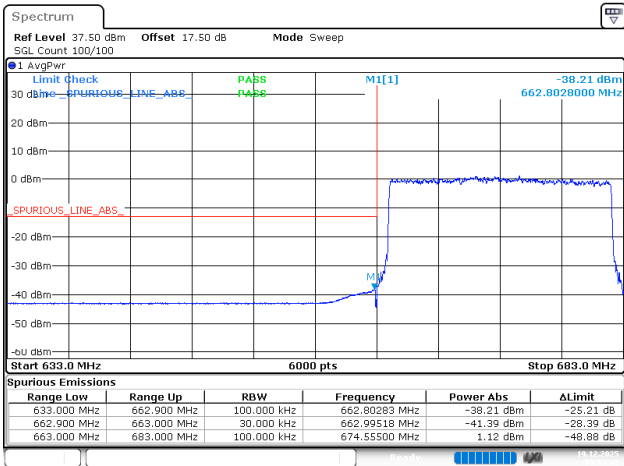


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:53:45

20MHz_Low_16QAM_1@0

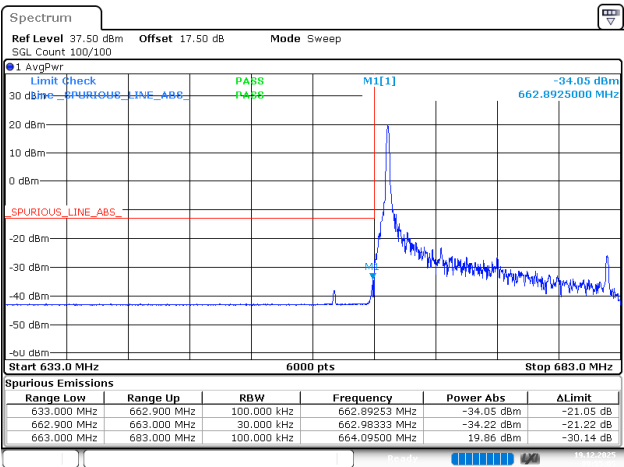


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:55:05

20MHz_Low_16QAM_100@0

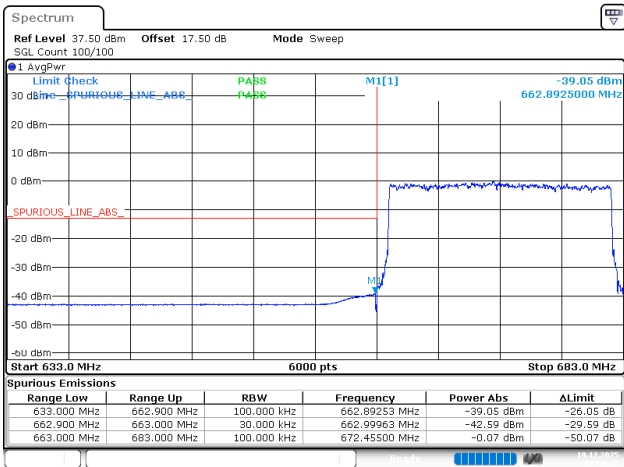


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:56:25

20MHz_High_QPSK_1@99

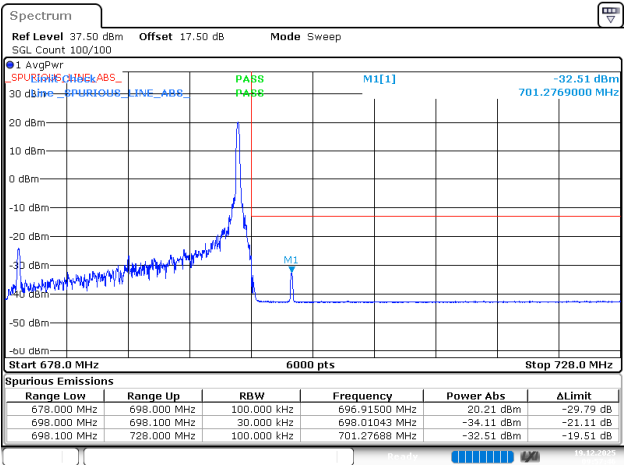


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:57:46

20MHz_High_QPSK_100@0

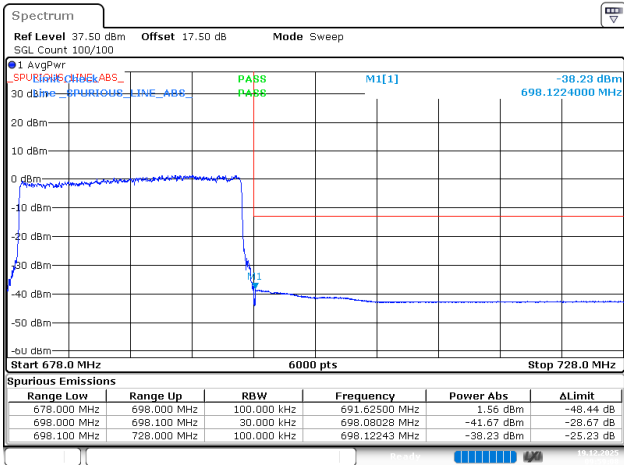


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 09:59:08

20MHz_High_16QAM_1@99

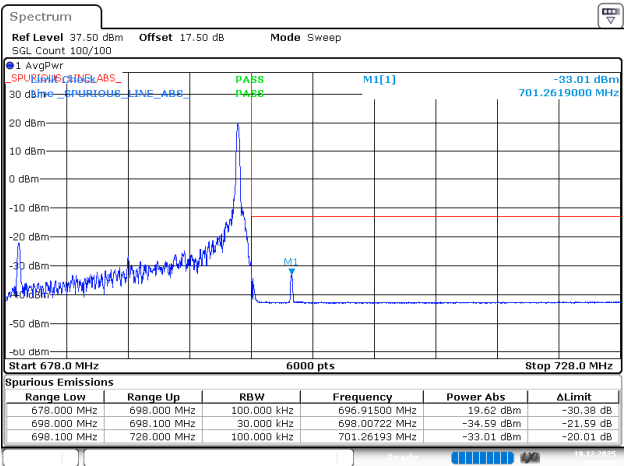

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 10:00:31

20MHz_High_16QAM_100@0

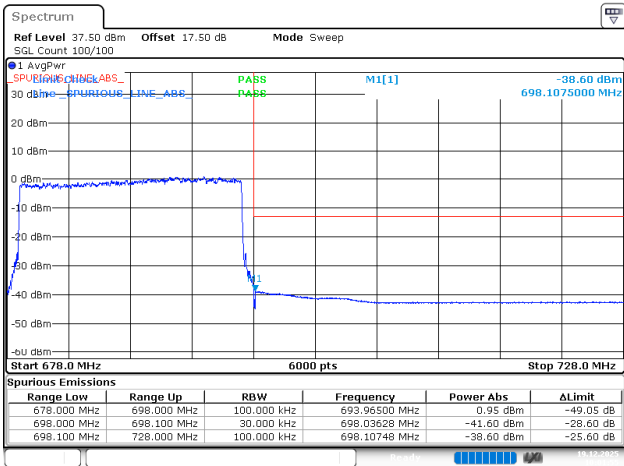


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 10:01:55

Spurious Emissions at Antenna Terminal

FCC Part 22H & IC RSS-132


LTE Band 5, Normal
1RB was the worst case

1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)

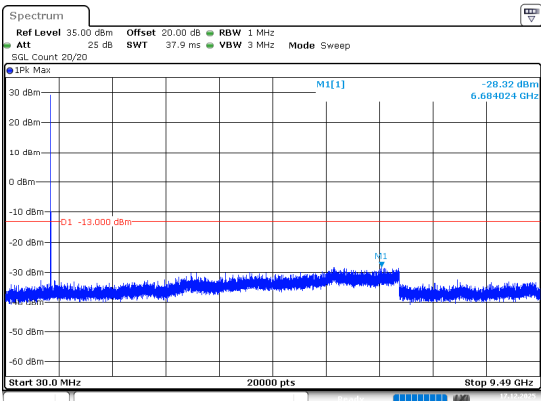


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:15:14

1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

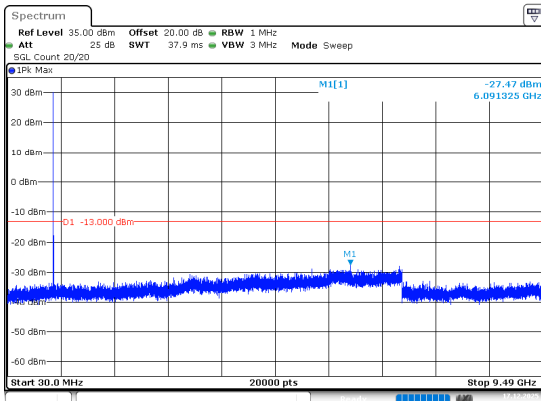


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:15:30

1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)

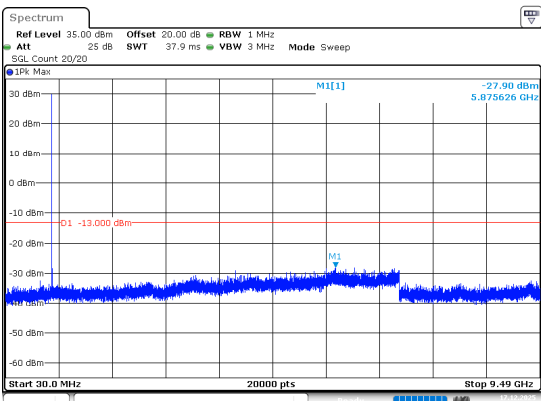


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:15:47

3MHz_Low_QPSK_1@0(30MHz~9.49GHz)

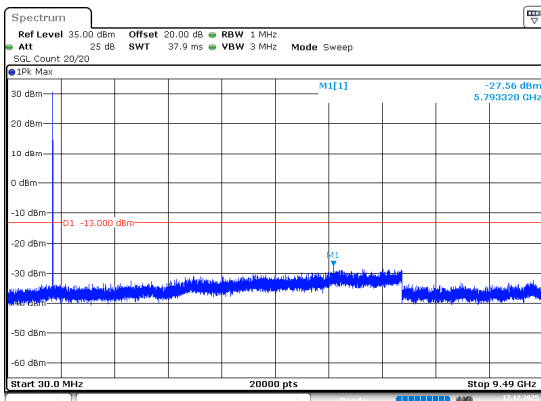


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:16:06

3MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

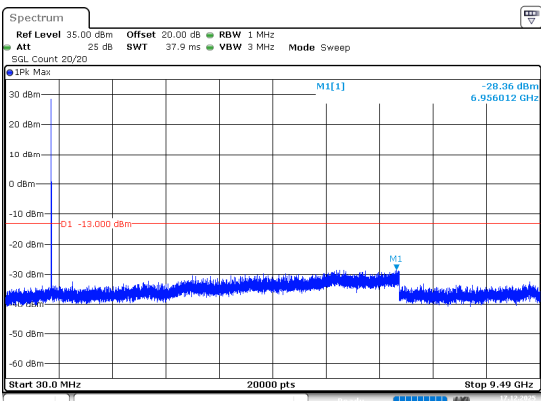


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:16:23

3MHz_High_QPSK_1@0(30MHz~9.49GHz)

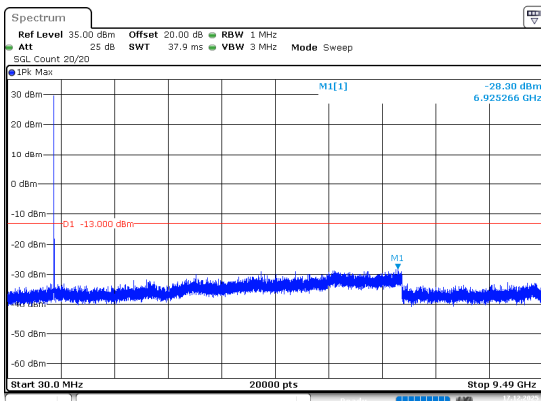


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:16:40

5MHz_Low_QPSK_1@0(30MHz~9.49GHz)

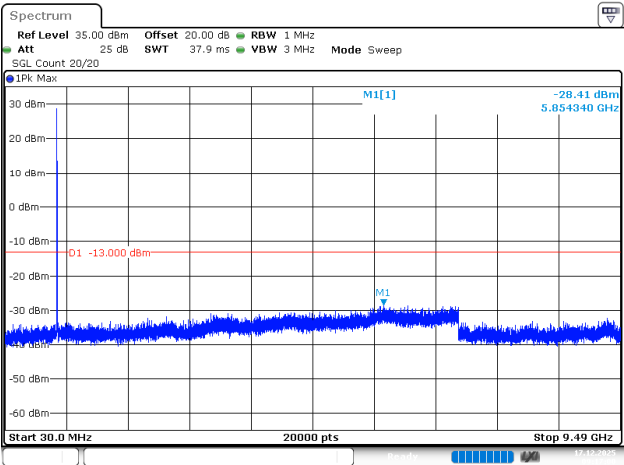


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:17:00

5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

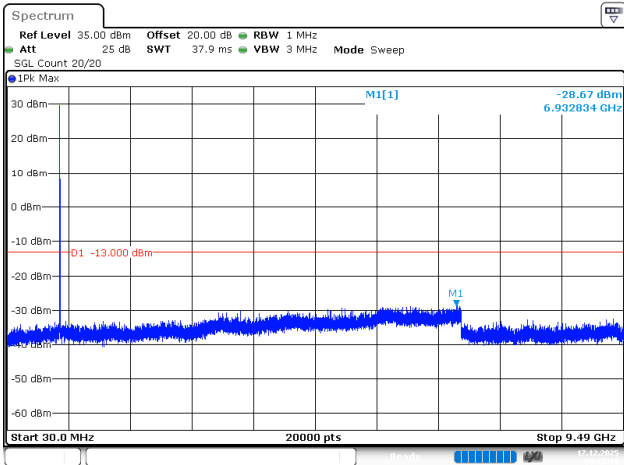


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:17:18

5MHz_High_QPSK_1@0(30MHz~9.49GHz)

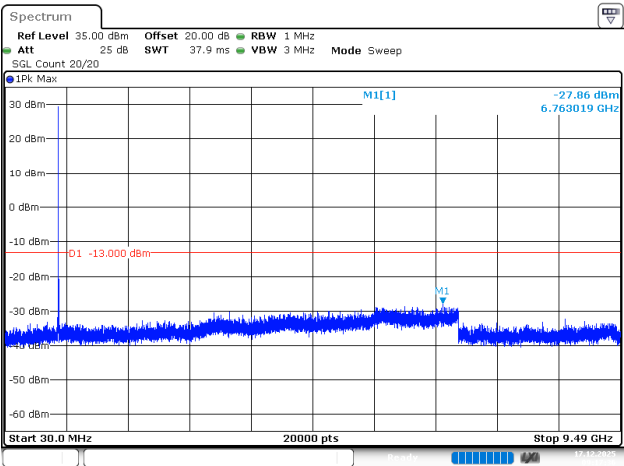


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:17:37

10MHz_Low_QPSK_1@0(30MHz~9.49GHz)

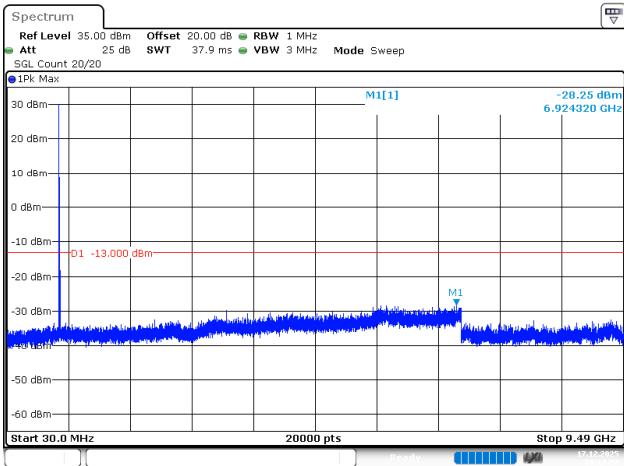


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:17:58

10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

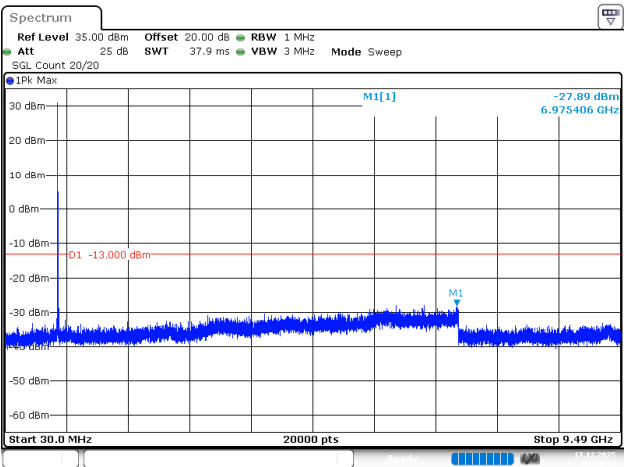

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:18:17

10MHz_High_QPSK_1@0(30MHz~9.49GHz)

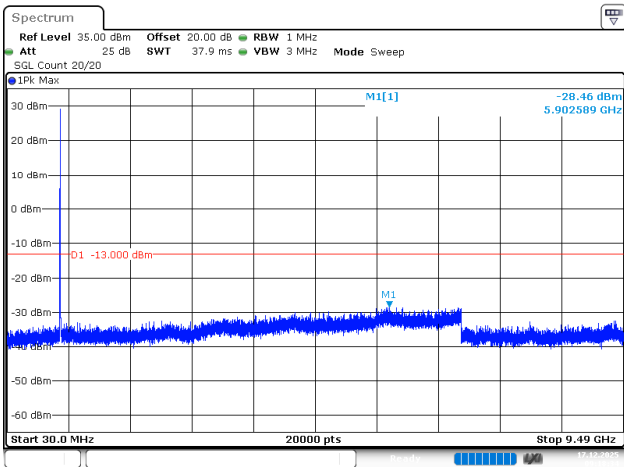


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:18:35


FCC Part 24E & IC RSS-133

LTE Band 2, Normal
1RB was the worst case


1.4MHz_Low_QPSK_1@0(30MHz~20.1GHz)

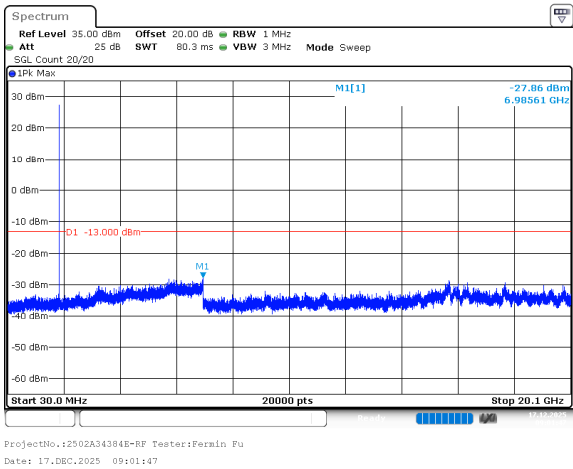


1.4MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

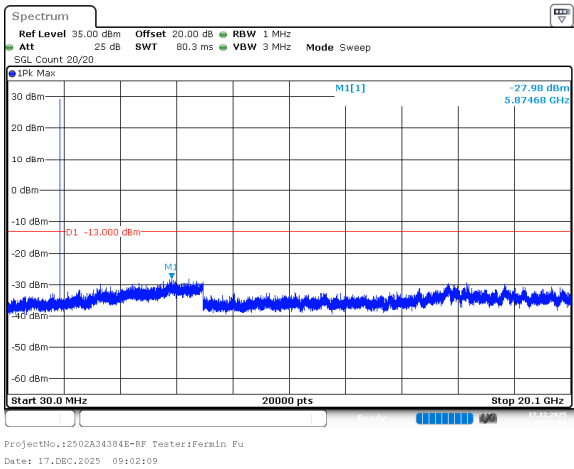


1.4MHz_High_QPSK_1@0(30MHz~20.1GHz)

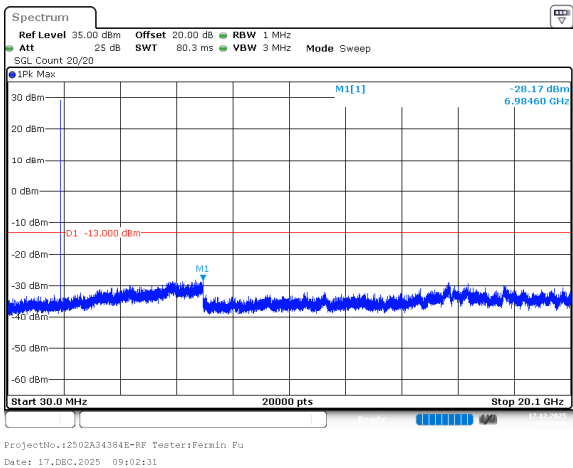


3MHz_Low_QPSK_1@0(30MHz~20.1GHz)

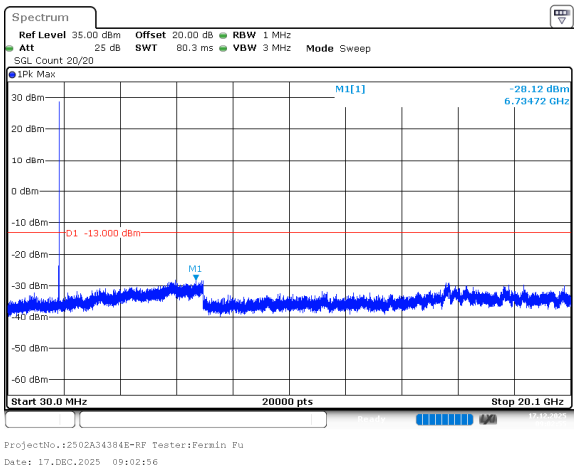


3MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

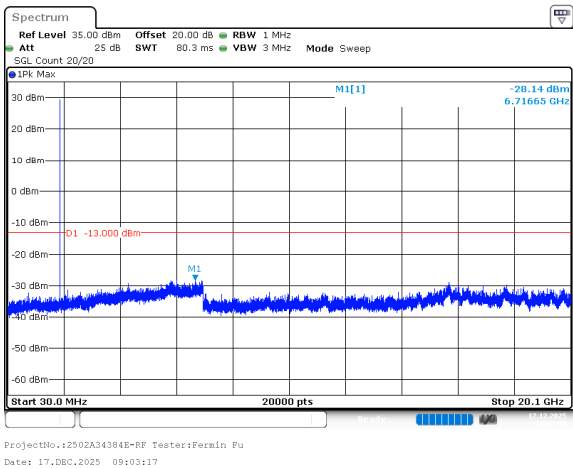

3MHz_High_QPSK_1@0(30MHz~20.1GHz)

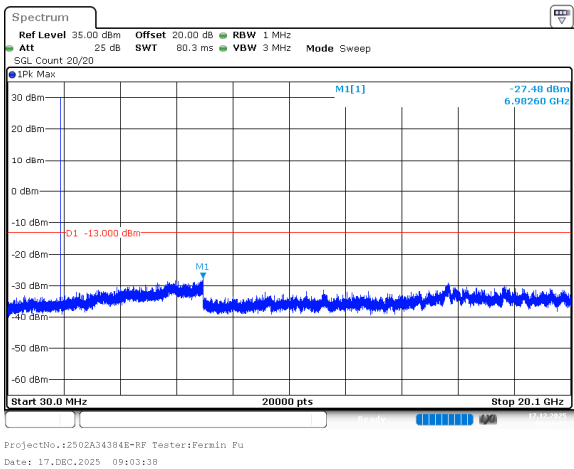


5MHz_Low_QPSK_1@0(30MHz~20.1GHz)

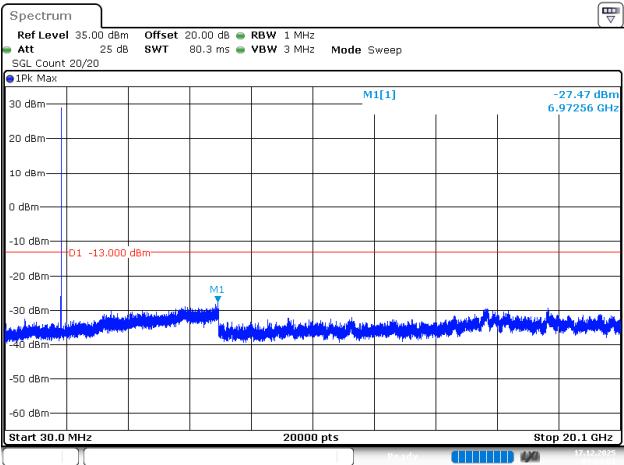


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:04:02

5MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

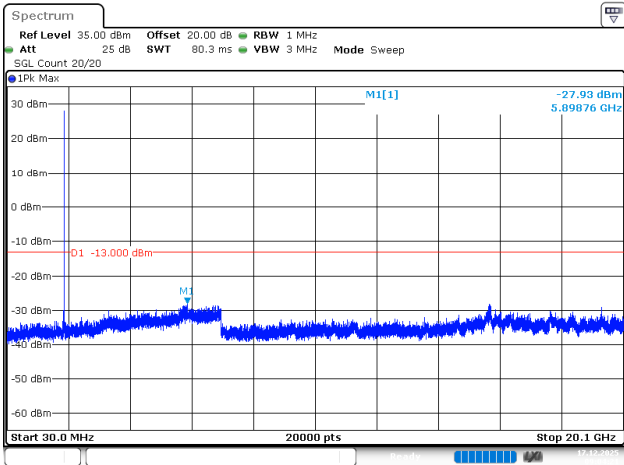


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:04:22

5MHz_High_QPSK_1@0(30MHz~20.1GHz)

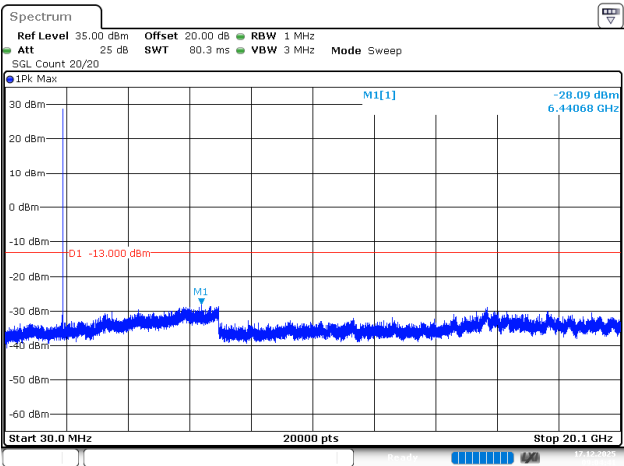


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:04:42

10MHz_Low_QPSK_1@0(30MHz~20.1GHz)

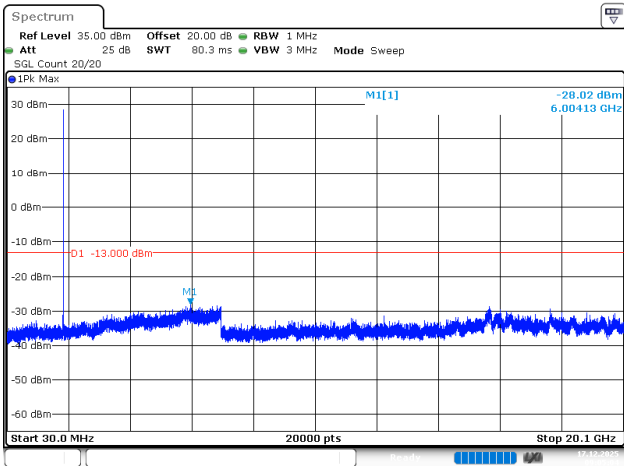


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:05:05

10MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

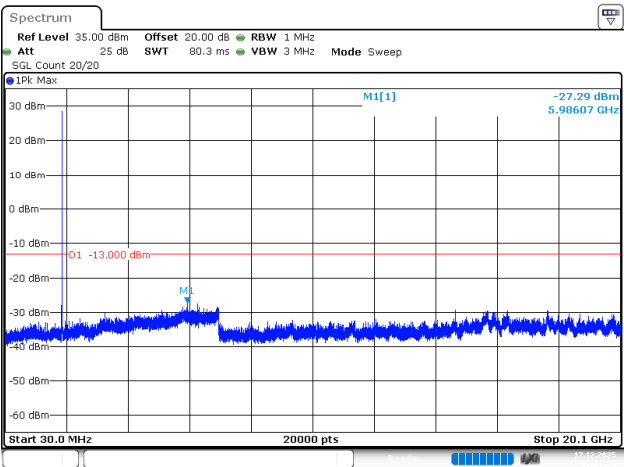


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:05:25

10MHz_High_QPSK_1@0(30MHz~20.1GHz)

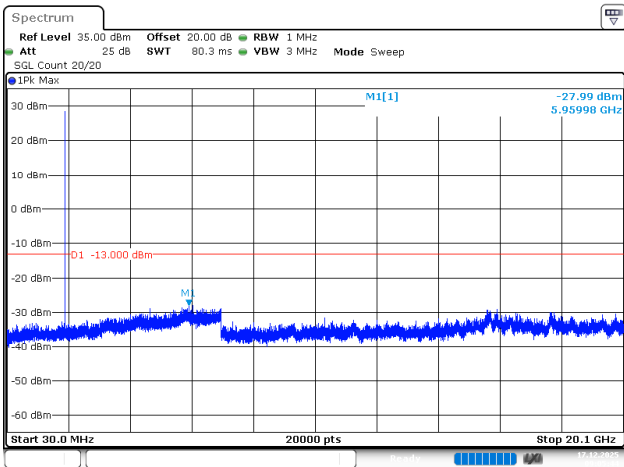


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:05:45

15MHz_Low_QPSK_1@0(30MHz~20.1GHz)

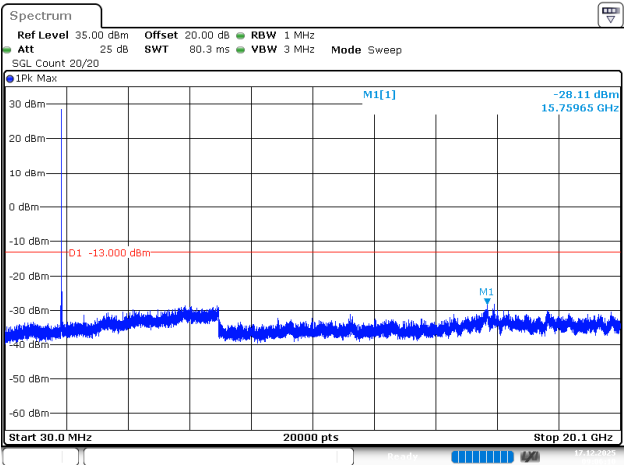


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:06:10

15MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

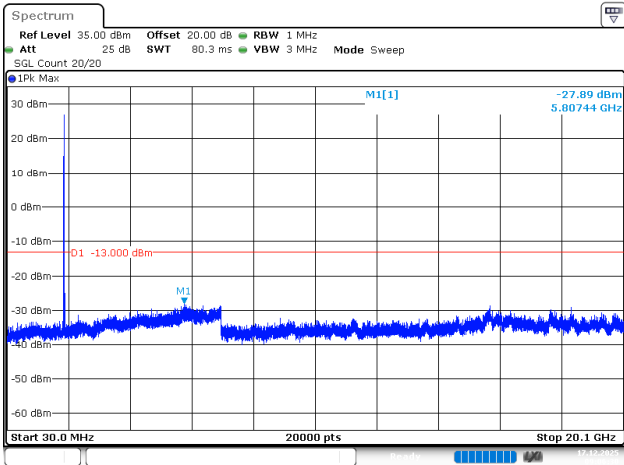


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:06:31

15MHz_High_QPSK_1@0(30MHz~20.1GHz)

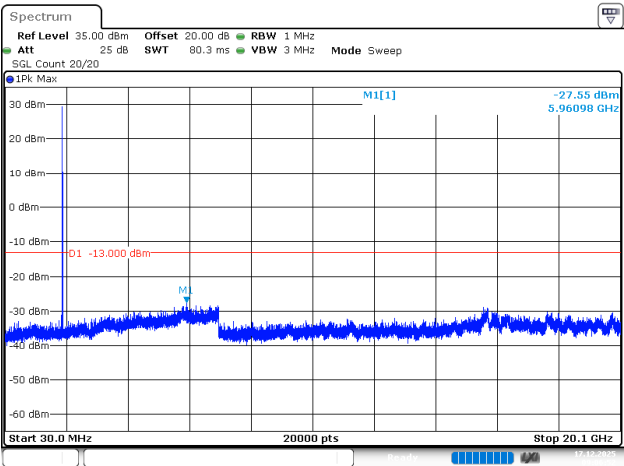


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:06:52

20MHz_Low_QPSK_1@0(30MHz~20.1GHz)

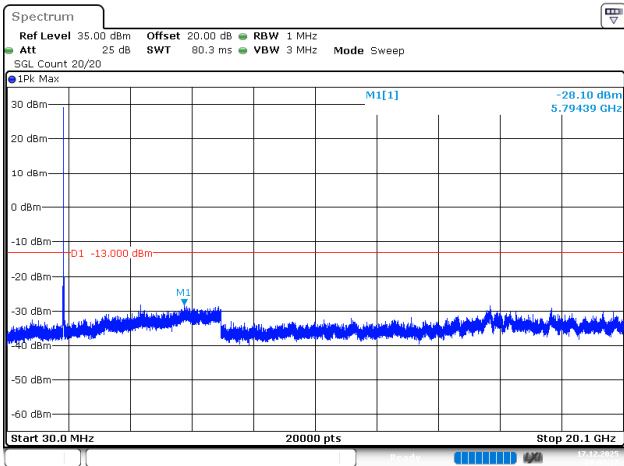


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:07:18

20MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

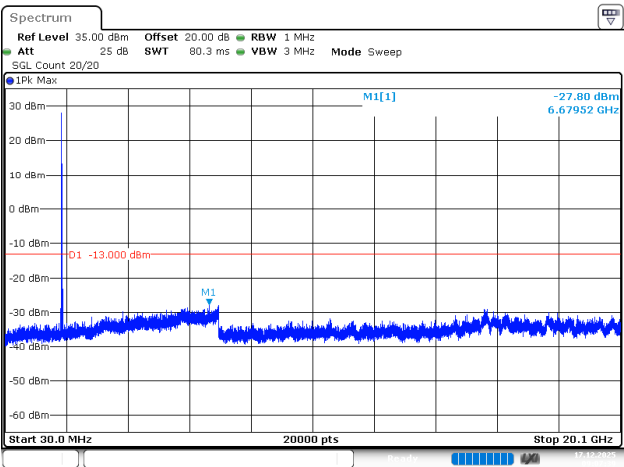

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:07:40




20MHz_High_QPSK_1@0(30MHz~20.1GHz)

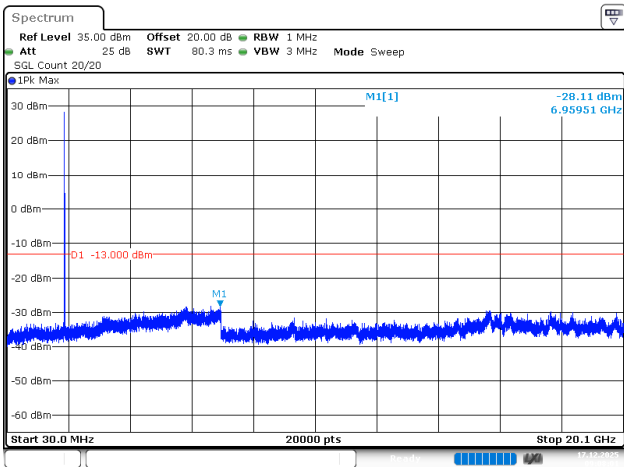


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:08:02

FCC Part 27 & IC RSS-139

LTE Band 4, Normal
1RB was the worst case

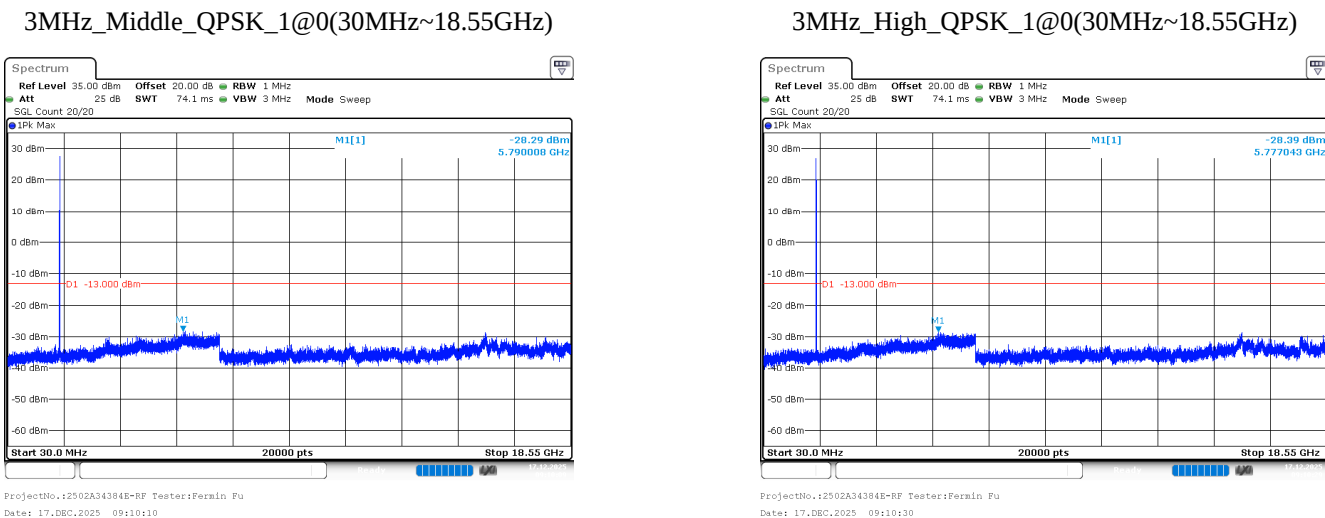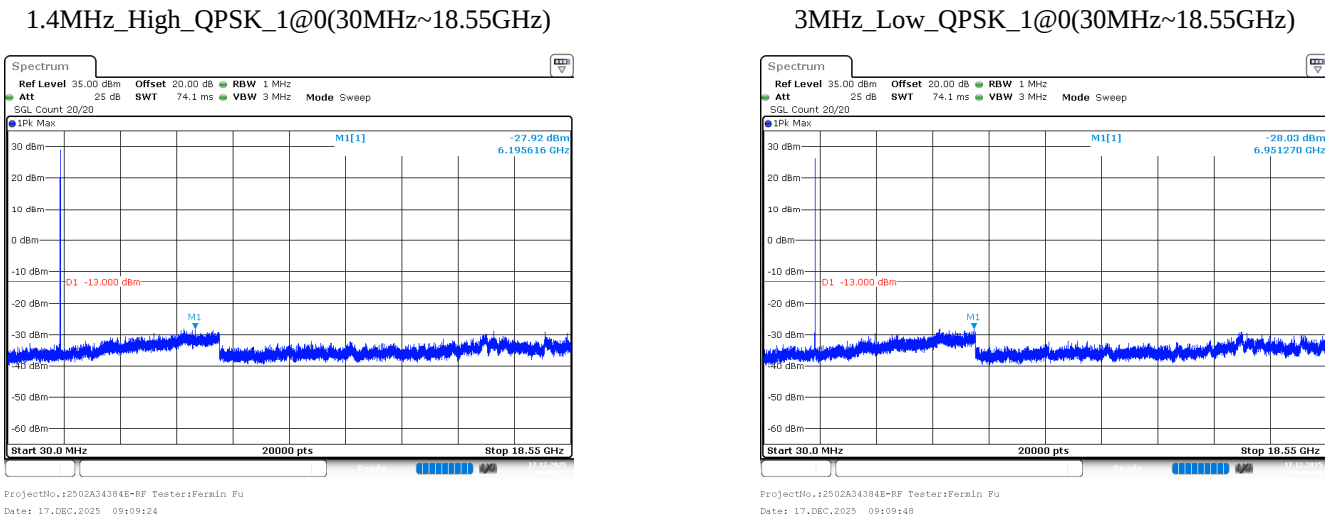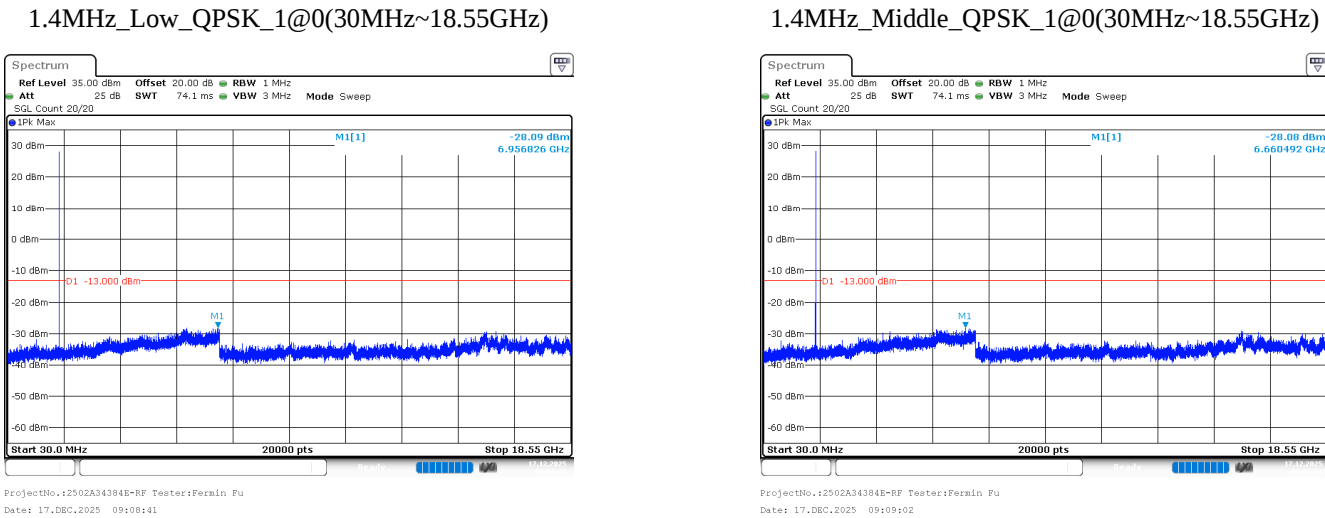


5MHz_Low_QPSK_1@0(30MHz~18.55GHz)

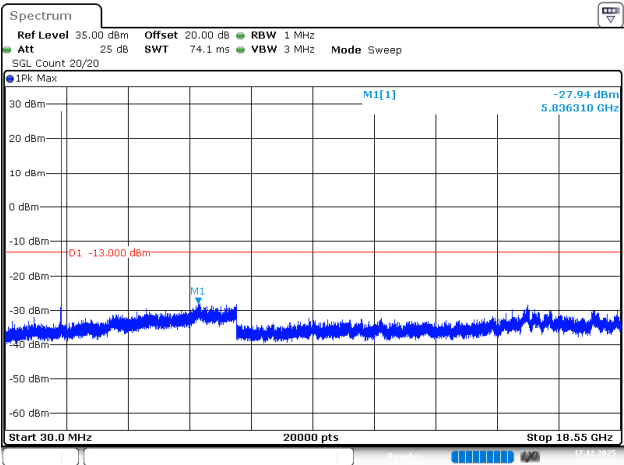


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:10:53

5MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

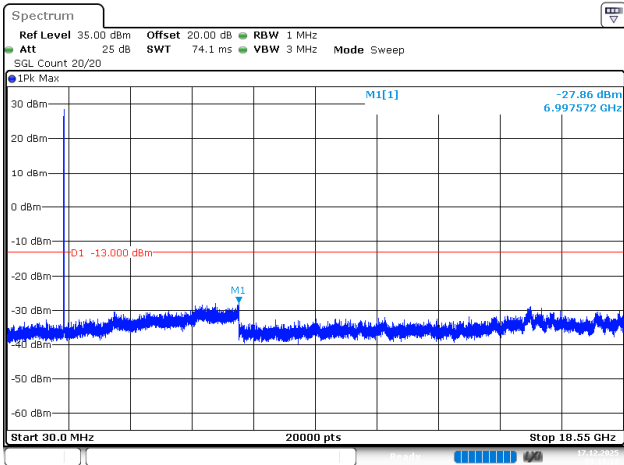


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:11:14

5MHz_High_QPSK_1@0(30MHz~18.55GHz)

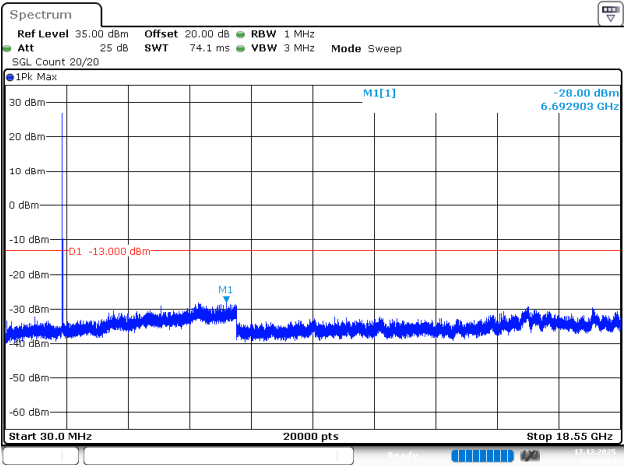


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:11:34

10MHz_Low_QPSK_1@0(30MHz~18.55GHz)

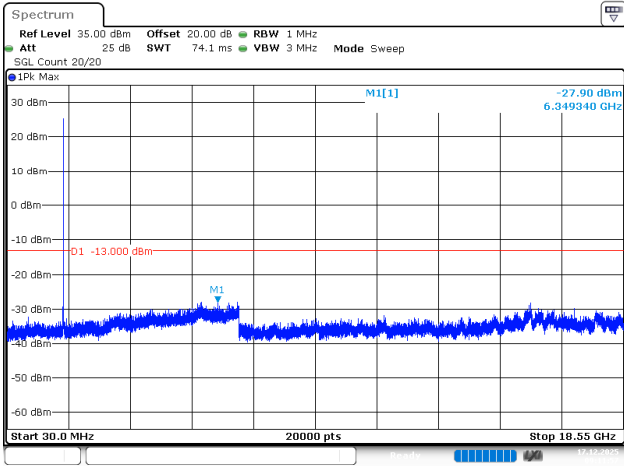


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:11:57

10MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

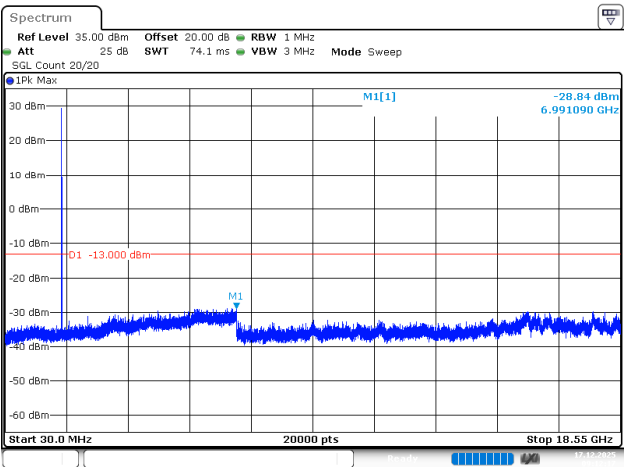


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:12:18

10MHz_High_QPSK_1@0(30MHz~18.55GHz)

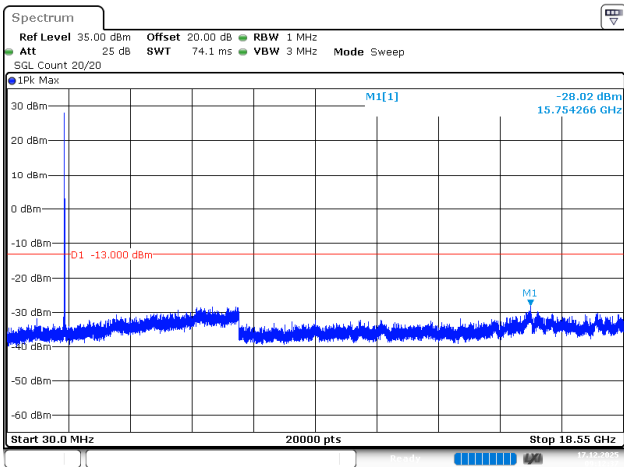


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:12:38

15MHz_Low_QPSK_1@0(30MHz~18.55GHz)

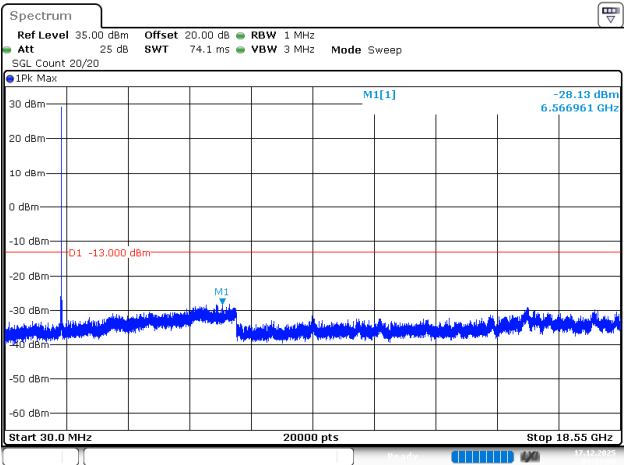


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:13:01

15MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

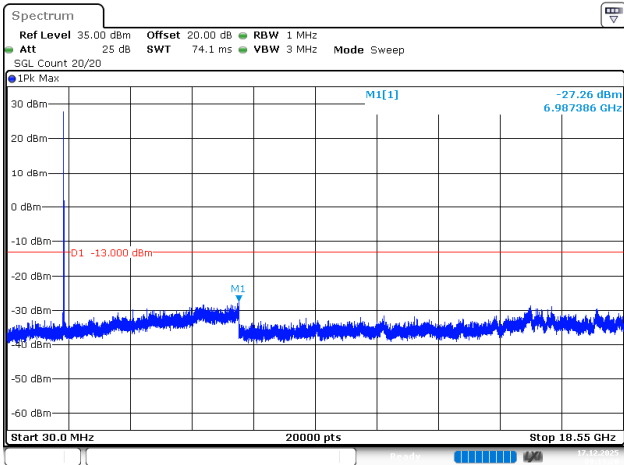


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:13:20

15MHz_High_QPSK_1@0(30MHz~18.55GHz)

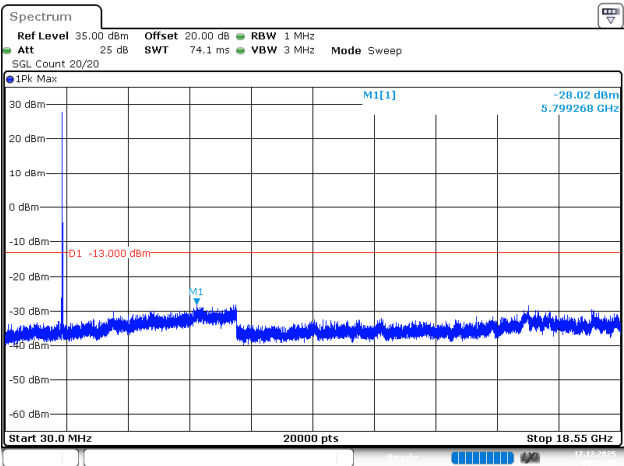


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:13:39

20MHz_Low_QPSK_1@0(30MHz~18.55GHz)

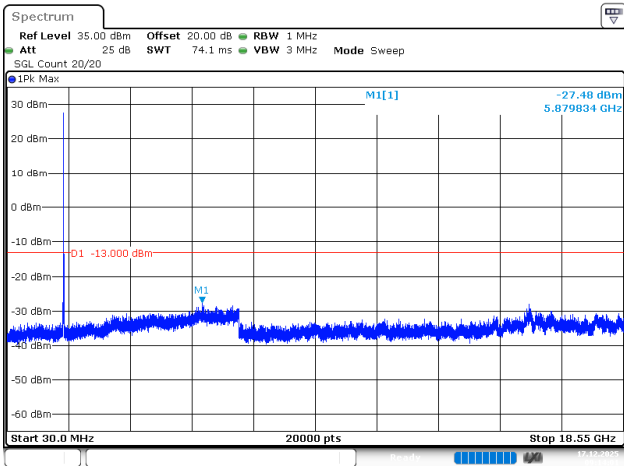


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:14:01

20MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

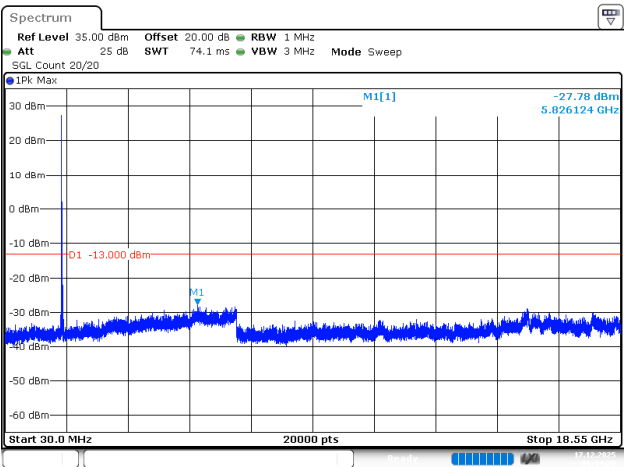

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:14:20

20MHz_High_QPSK_1@0(30MHz~18.55GHz)

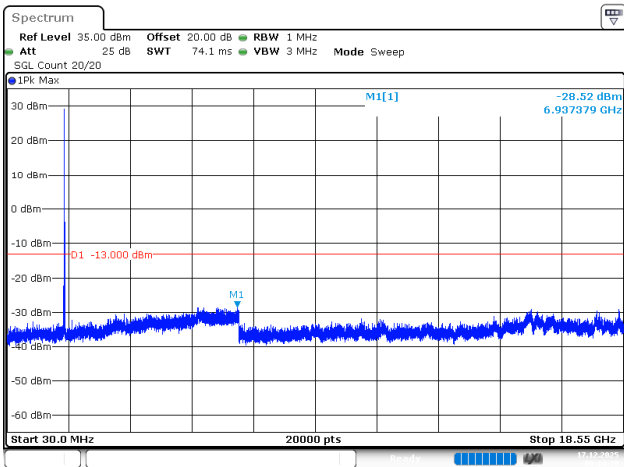


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:14:40


LTE Band 7, Normal

1RB was the worst case


5MHz_Low_QPSK_1@0(30MHz~26.7GHz)

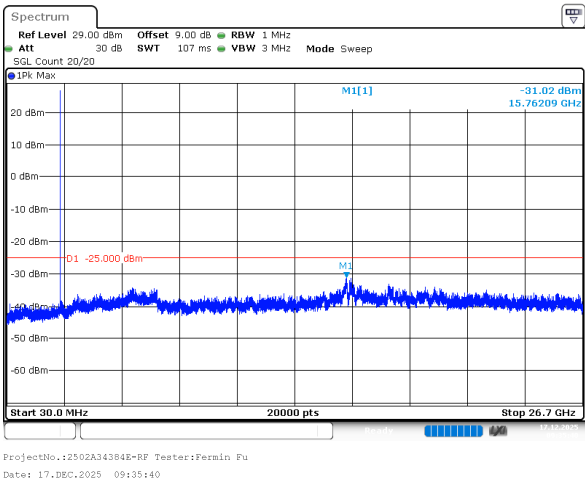


5MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

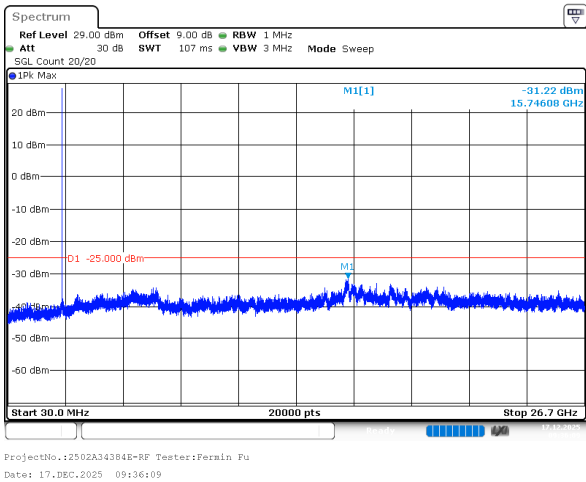


5MHz_High_QPSK_1@0(30MHz~26.7GHz)

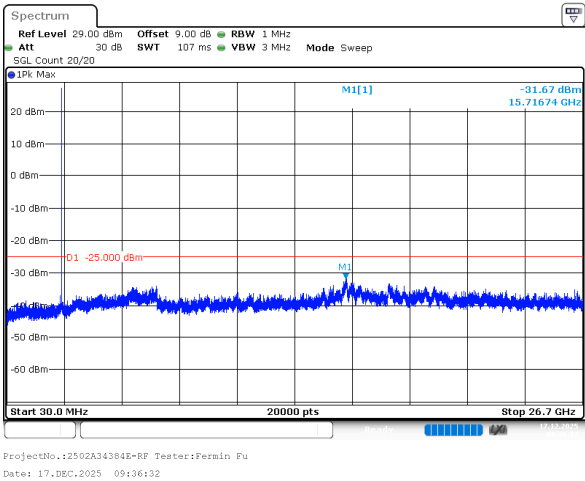


10MHz_Low_QPSK_1@0(30MHz~26.7GHz)

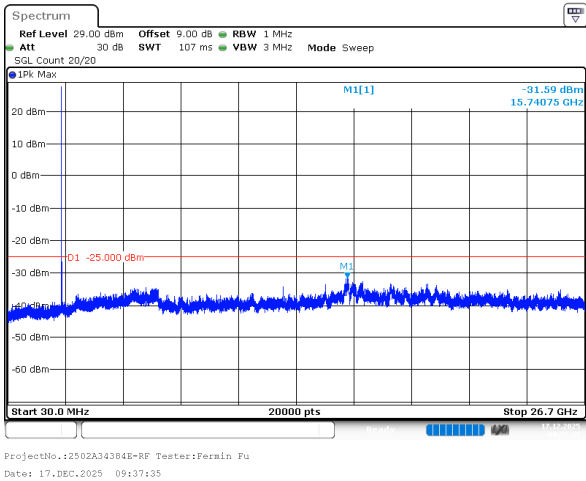


10MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

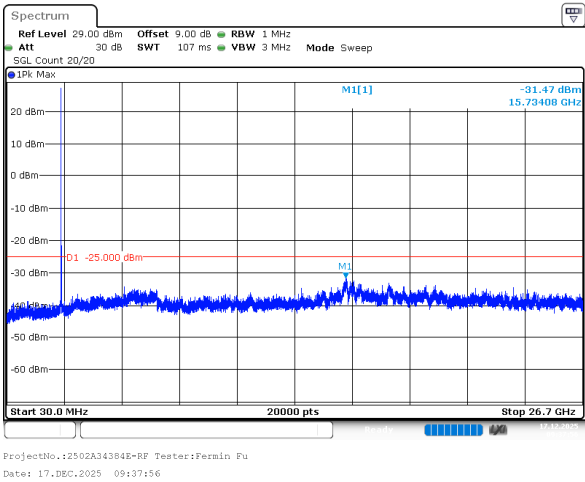

10MHz_High_QPSK_1@0(30MHz~26.7GHz)

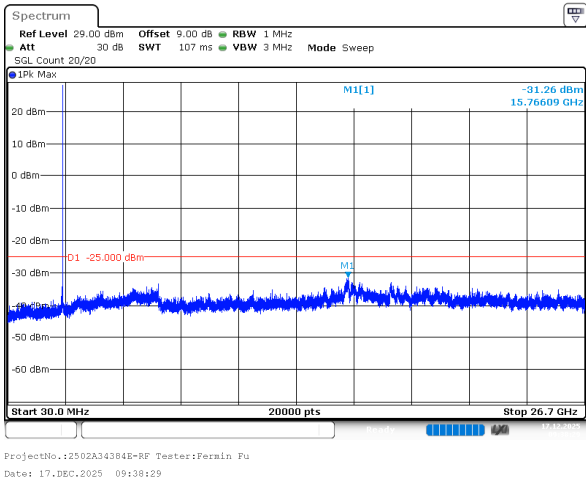


15MHz_Low_QPSK_1@0(30MHz~26.7GHz)

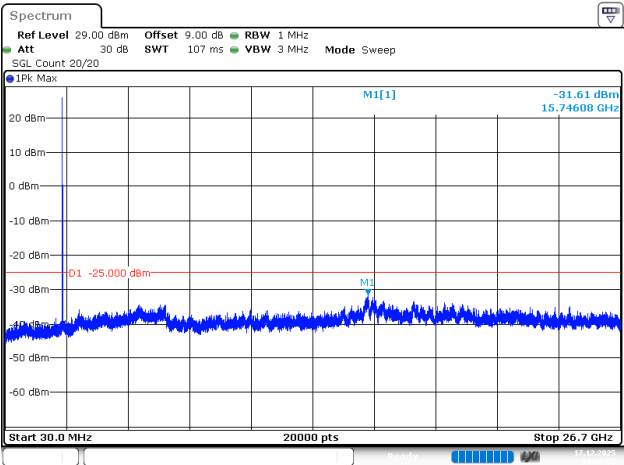


ProjectNo.:2502A34384E-RF Tester:Fermin Fu
Date: 17.DEC.2025 09:38:53

15MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

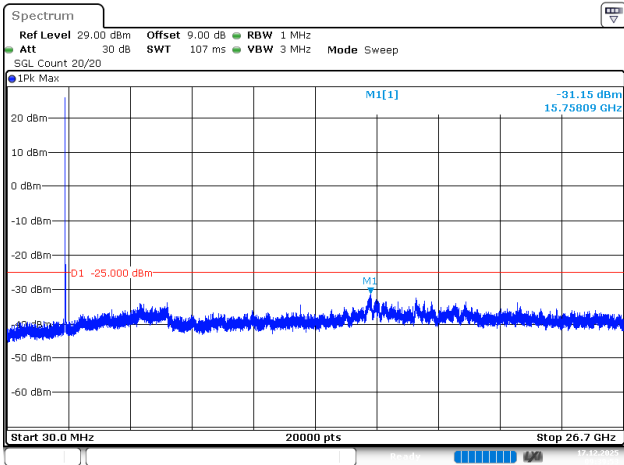


ProjectNo.:2502A34384E-RF Tester:Fermin Fu
Date: 17.DEC.2025 09:39:53

15MHz_High_QPSK_1@0(30MHz~26.7GHz)

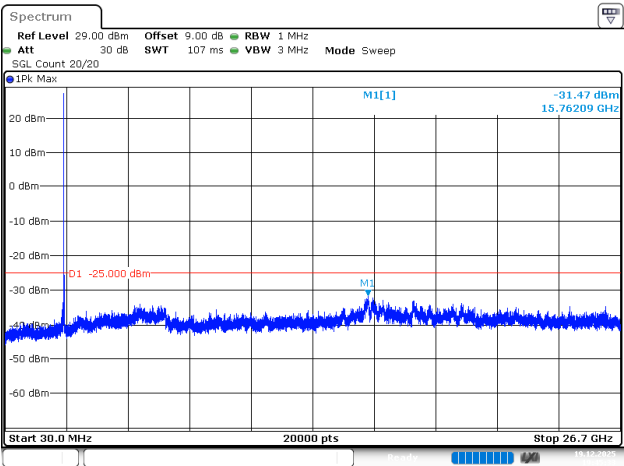


ProjectNo.:2502A34384E-RF Tester:Fermin Fu
Date: 19.DEC.2025 19:45:32

20MHz_Low_QPSK_1@0(30MHz~26.7GHz)

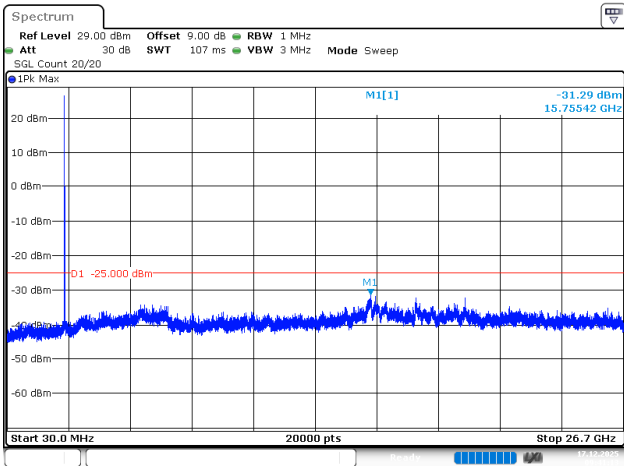


ProjectNo.:2502A34384E-RF Tester:Fermin Fu
Date: 17.DEC.2025 09:41:13

20MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

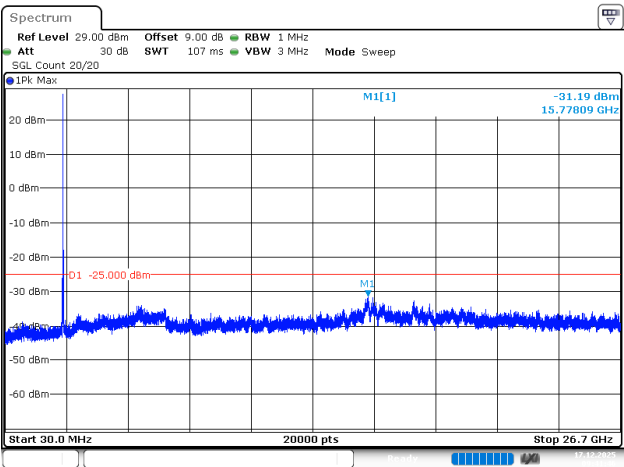

ProjectNo.:2502A34384E-RF Tester:Fermin Fu
Date: 17.DEC.2025 09:41:46

20MHz_High_QPSK_1@0(30MHz~26.7GHz)

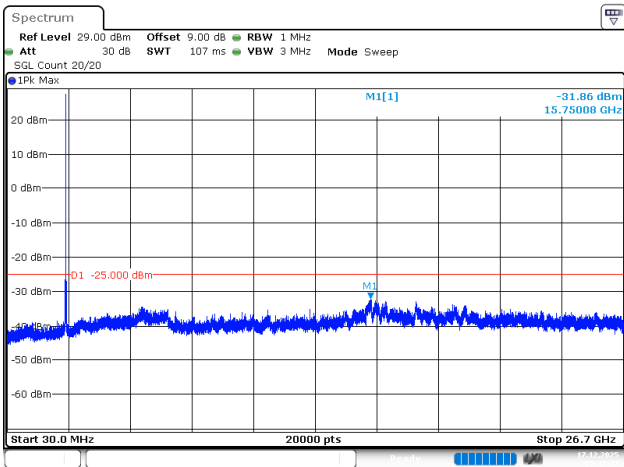


ProjectNo.:2502A34384E-RF Tester:Fermin Fu
Date: 17.DEC.2025 09:42:37


LTE Band 12, Normal

1RB was the worst case


1.4MHz_Low_QPSK_1@0(30MHz~8.16GHz)

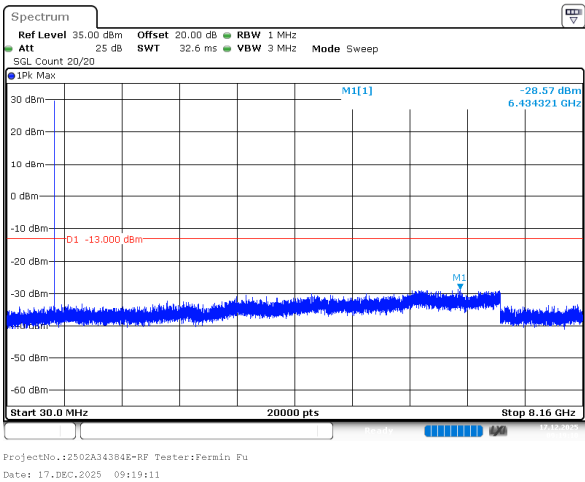


1.4MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

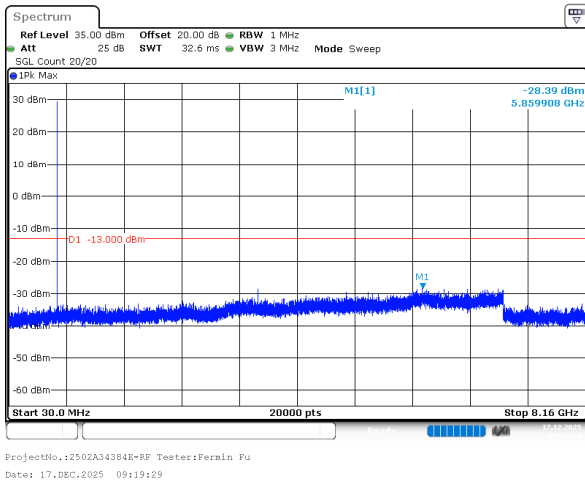


1.4MHz_High_QPSK_1@0(30MHz~8.16GHz)

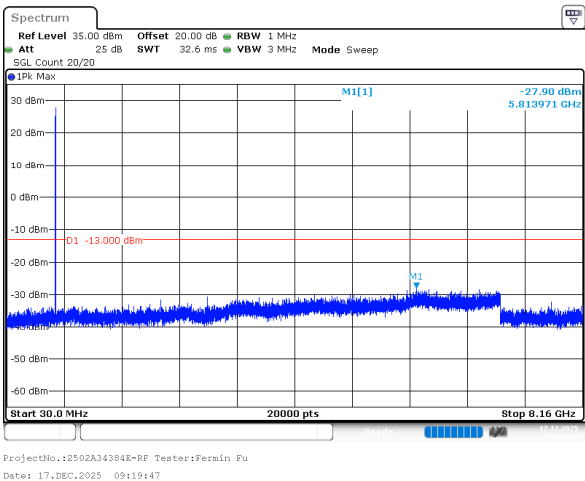


3MHz_Low_QPSK_1@0(30MHz~8.16GHz)

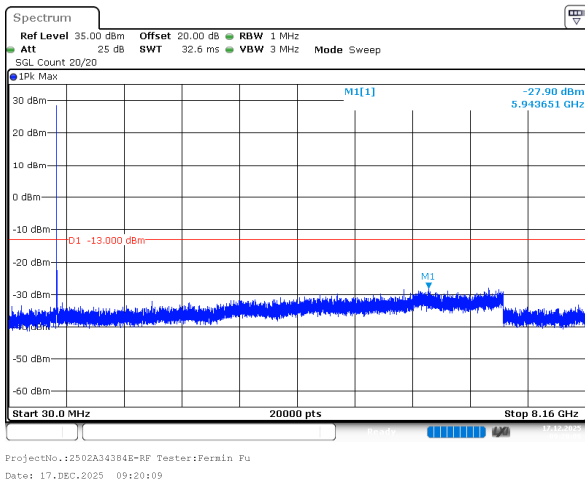


3MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

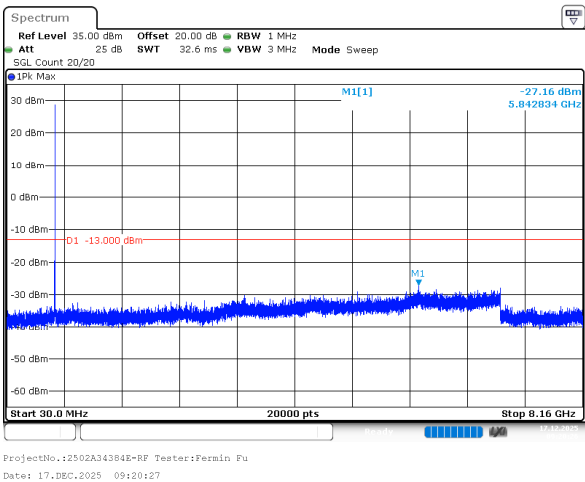

3MHz_High_QPSK_1@0(30MHz~8.16GHz)

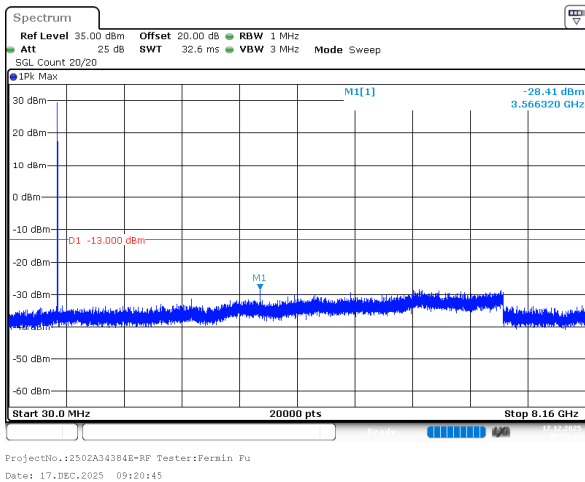


5MHz_Low_QPSK_1@0(30MHz~8.16GHz)

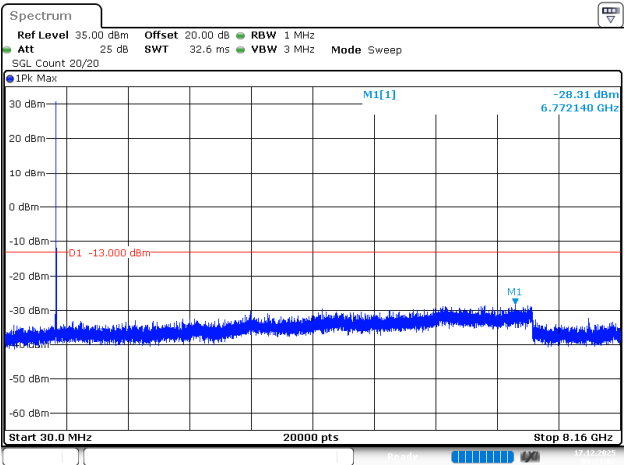


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:21:08

5MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

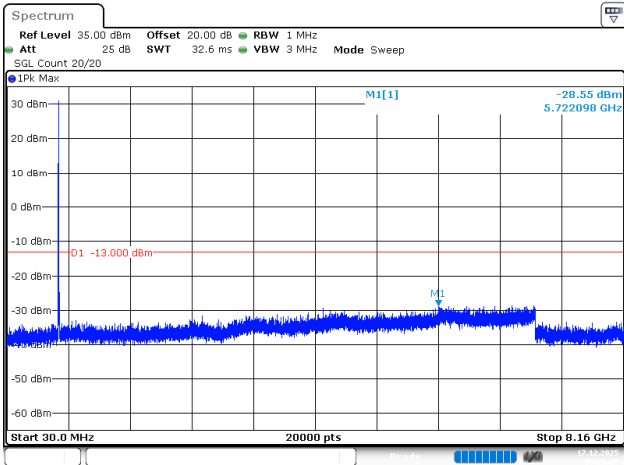


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:21:25

5MHz_High_QPSK_1@0(30MHz~8.16GHz)

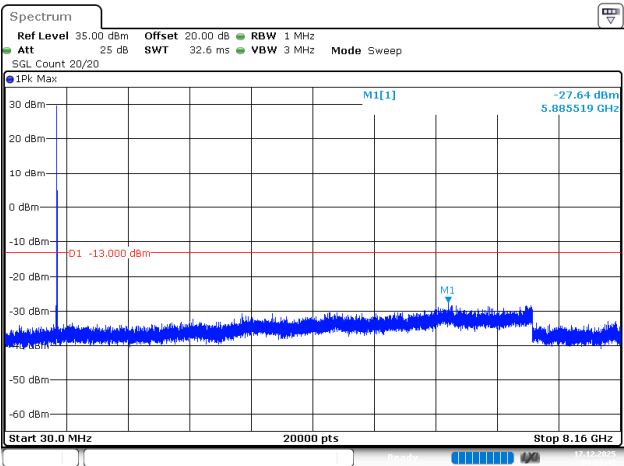


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:21:43

10MHz_Low_QPSK_1@0(30MHz~8.16GHz)

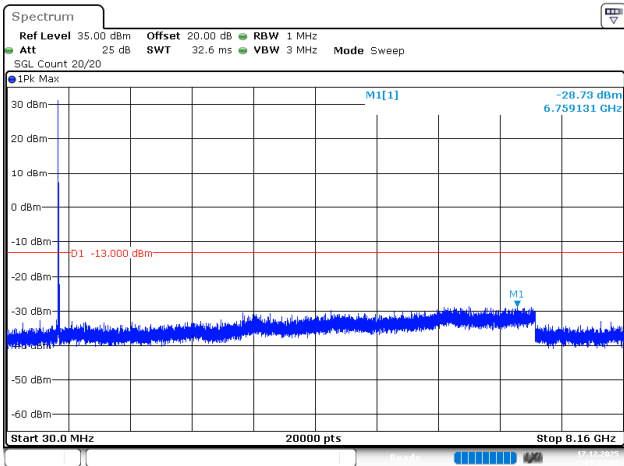


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:22:03

10MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

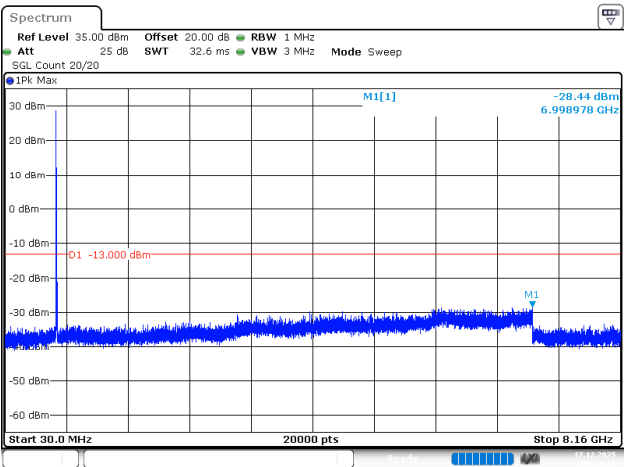

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:22:19

10MHz_High_QPSK_1@0(30MHz~8.16GHz)

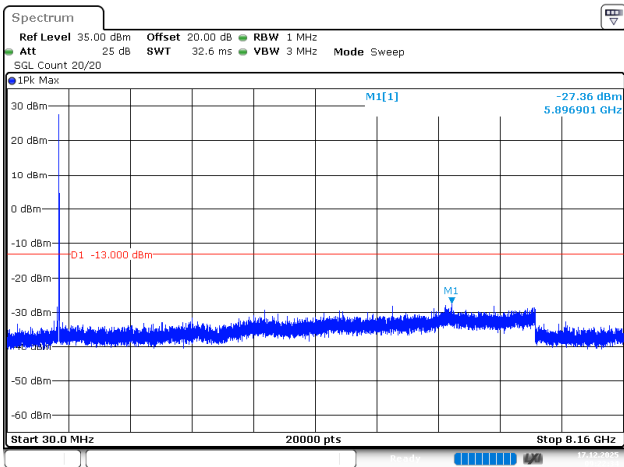


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:22:35

FCC Part 27 & IC RSS-130

LTE Band 17, Normal


1RB was the worst case

5MHz_Low_QPSK_1@0(30MHz~8.16GHz)

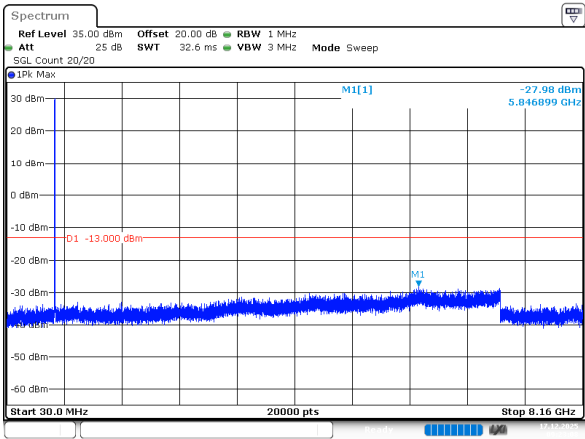


ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:23:09

5MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

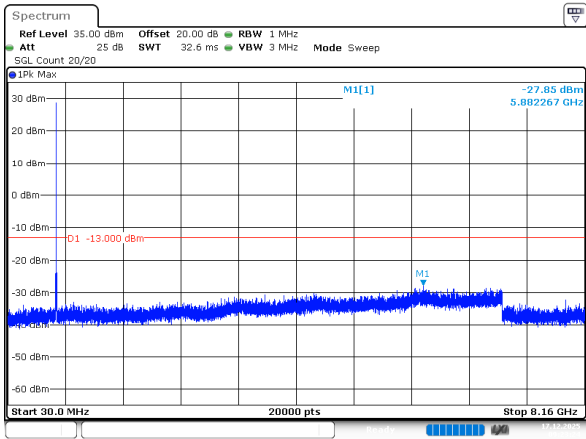


ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:23:25

5MHz_High_QPSK_1@0(30MHz~8.16GHz)

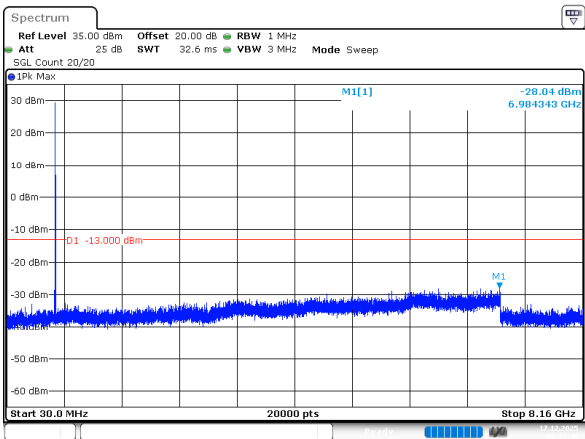


ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:23:41

10MHz_Low_QPSK_1@0(30MHz~8.16GHz)

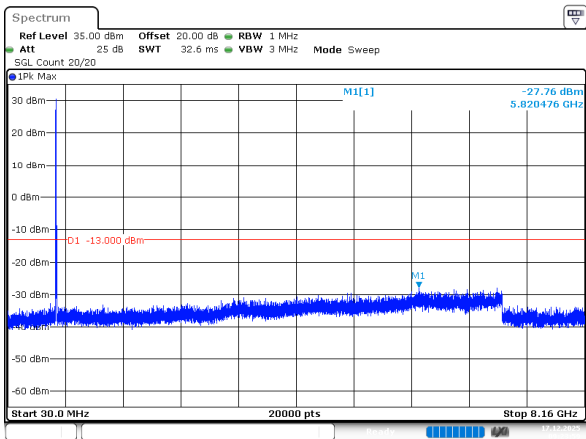


ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:24:00

10MHz_Middle_QPSK_1@0(30MHz~8.16GHz)

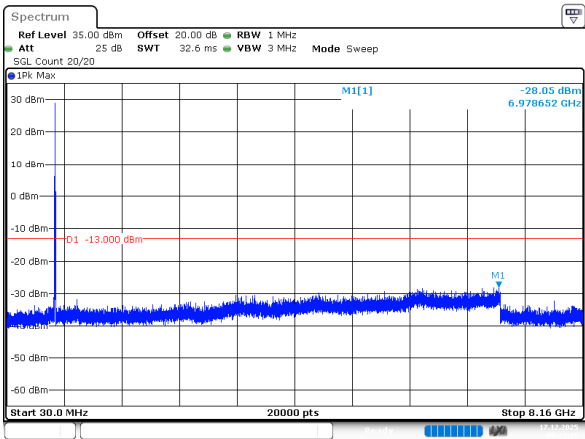

ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:24:15

10MHz_High_QPSK_1@0(30MHz~8.16GHz)

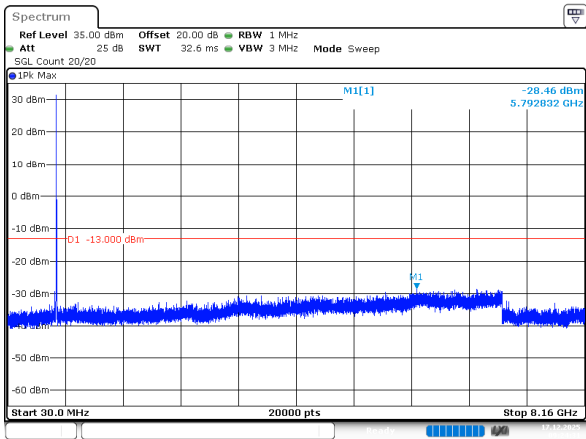


ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:24:31

FCC Part 27 & IC RSS-139


LTE Band 66, Normal
1RB was the worst case

1.4MHz_Low_QPSK_1@0(30MHz~18.8GHz)

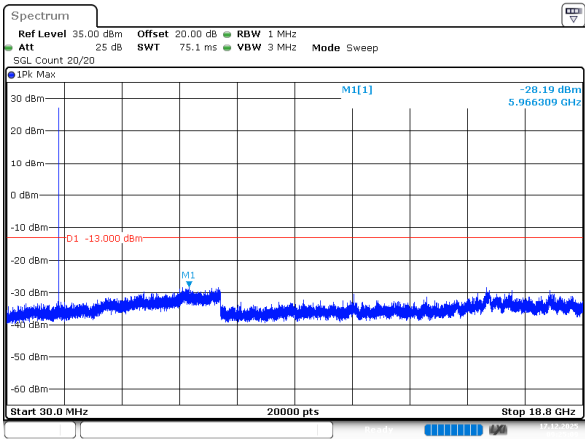


ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:25:10

1.4MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

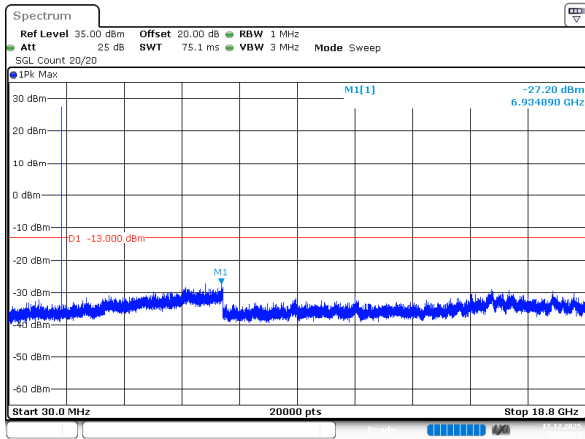


ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:25:29

1.4MHz_High_QPSK_1@0(30MHz~18.8GHz)

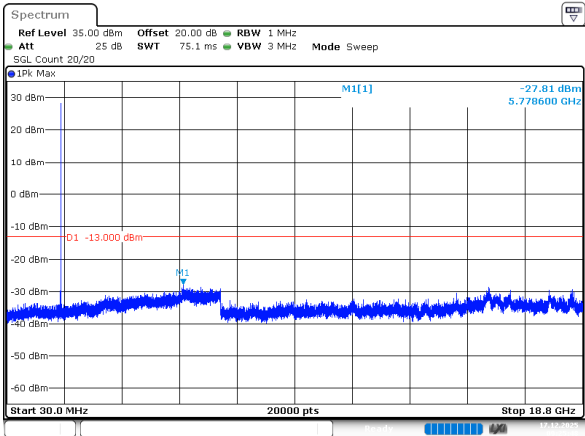


ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:25:48

3MHz_Low_QPSK_1@0(30MHz~18.8GHz)

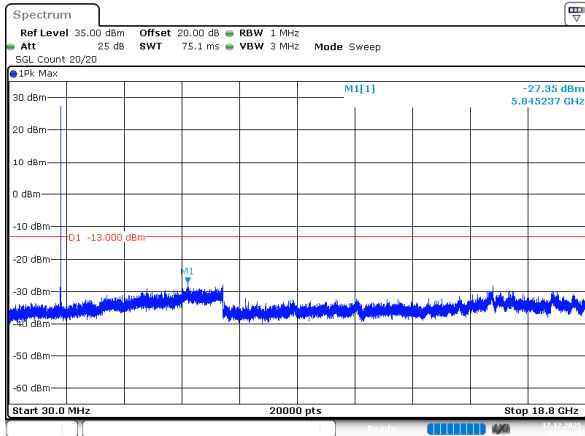


ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:26:11

3MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

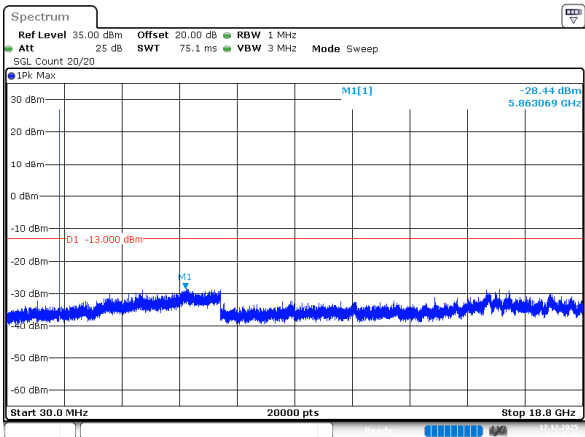


ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:26:31

3MHz_High_QPSK_1@0(30MHz~18.8GHz)

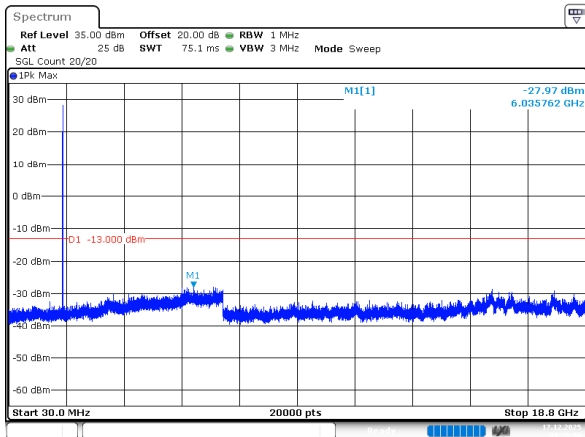


ProjectNo.:2502A34384E-RF Tester:Permin Pu
Date: 17.DEC.2025 09:26:51

5MHz_Low_QPSK_1@0(30MHz~18.8GHz)

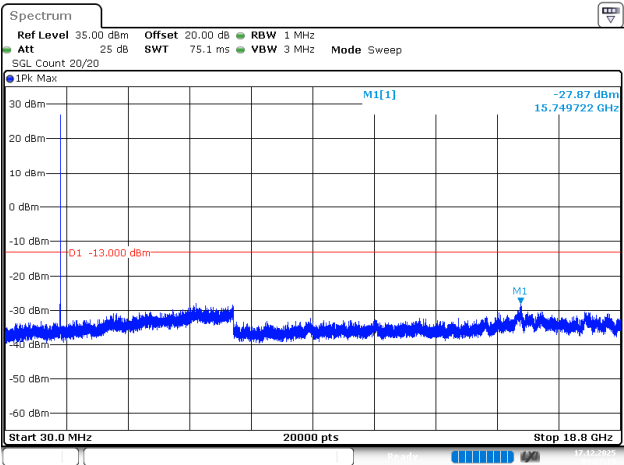


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:27:16

5MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

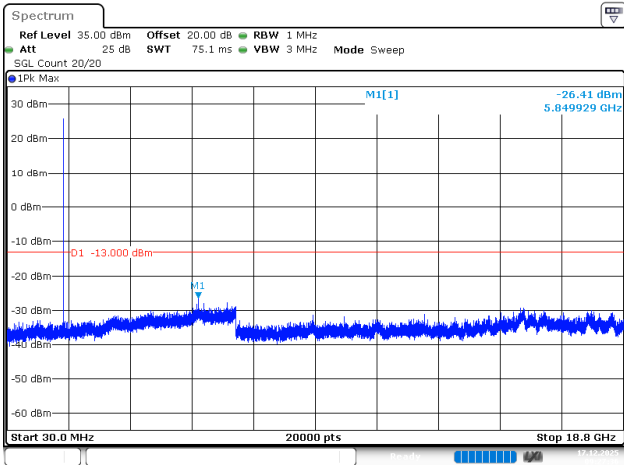


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:27:37

5MHz_High_QPSK_1@0(30MHz~18.8GHz)

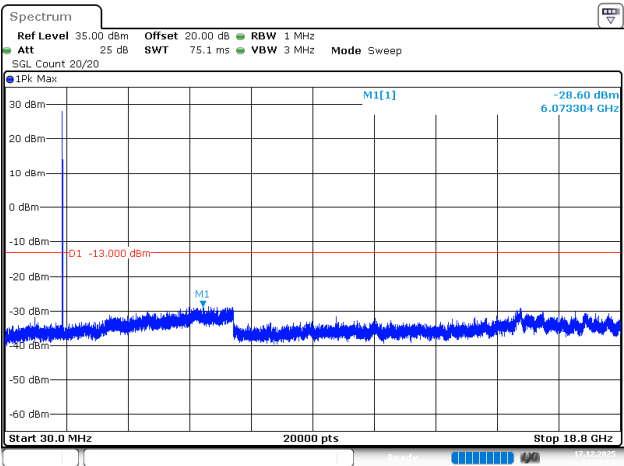


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:27:59

10MHz_Low_QPSK_1@0(30MHz~18.8GHz)

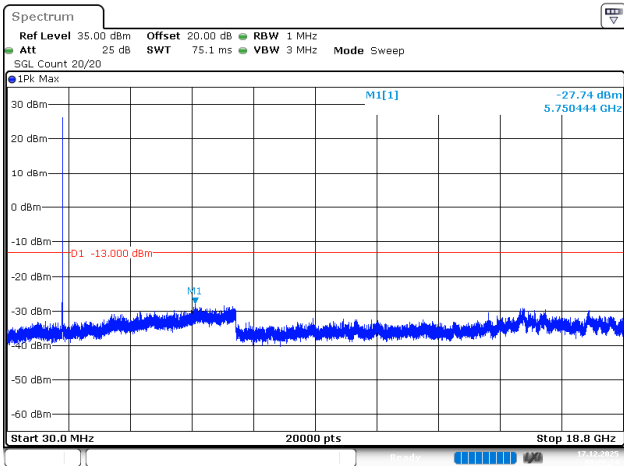


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:28:23

10MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

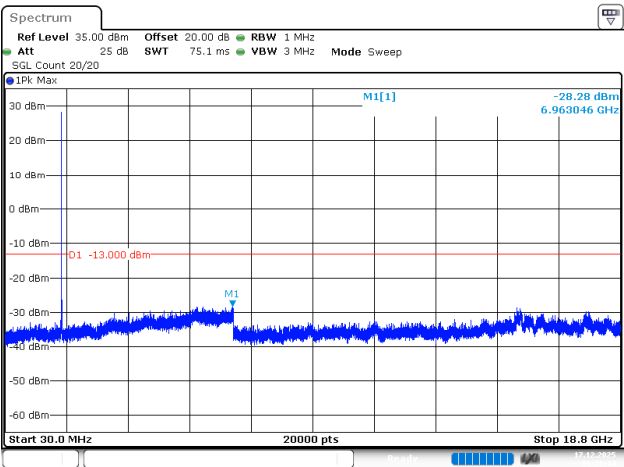


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:28:44

10MHz_High_QPSK_1@0(30MHz~18.8GHz)

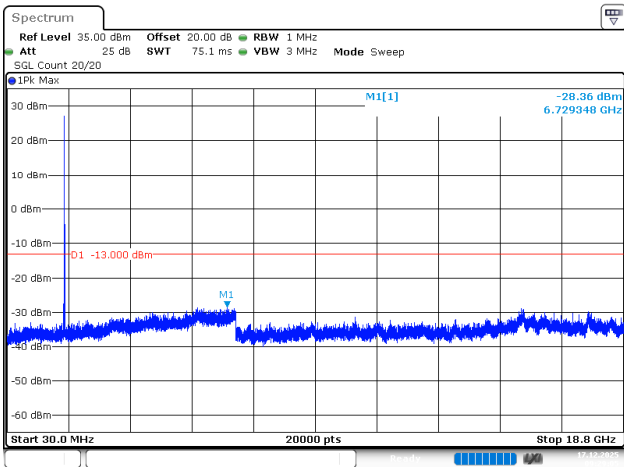


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:29:05

15MHz_Low_QPSK_1@0(30MHz~18.8GHz)

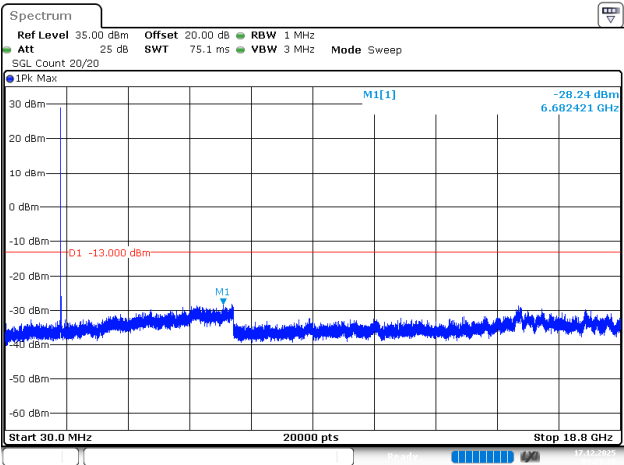


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:29:30

15MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

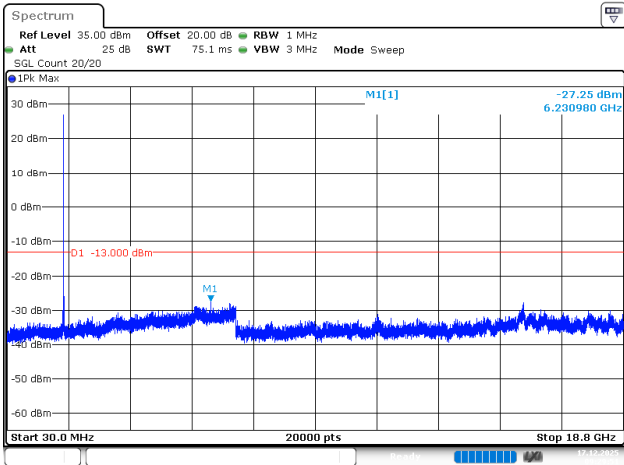


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:29:51

15MHz_High_QPSK_1@0(30MHz~18.8GHz)

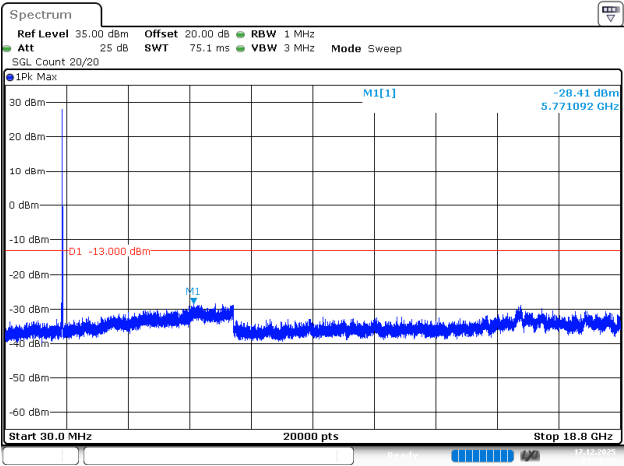


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:30:25

20MHz_Low_QPSK_1@0(30MHz~18.8GHz)

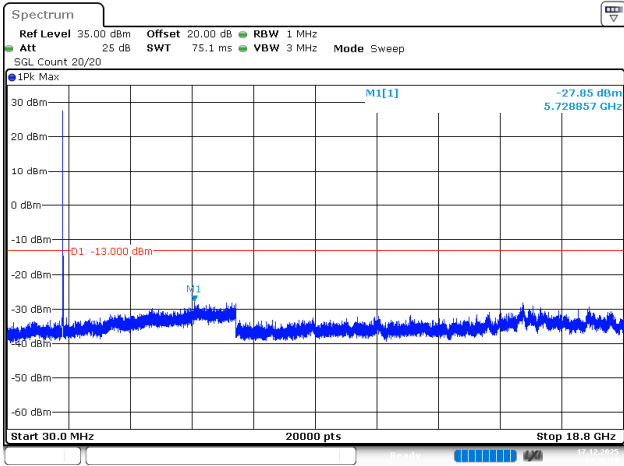


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:30:50

20MHz_Middle_QPSK_1@0(30MHz~18.8GHz)

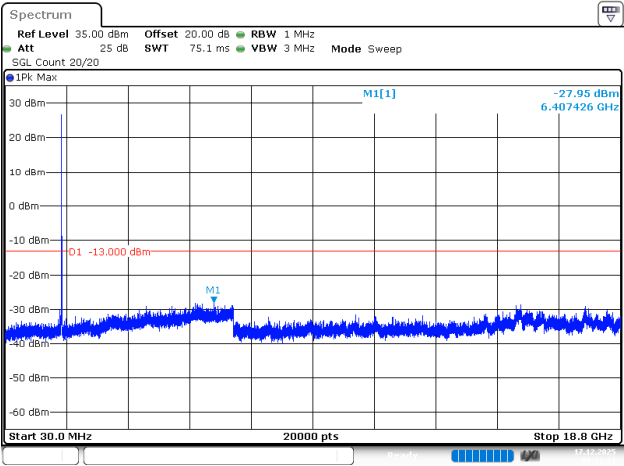

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:31:11

20MHz_High_QPSK_1@0(30MHz~18.8GHz)

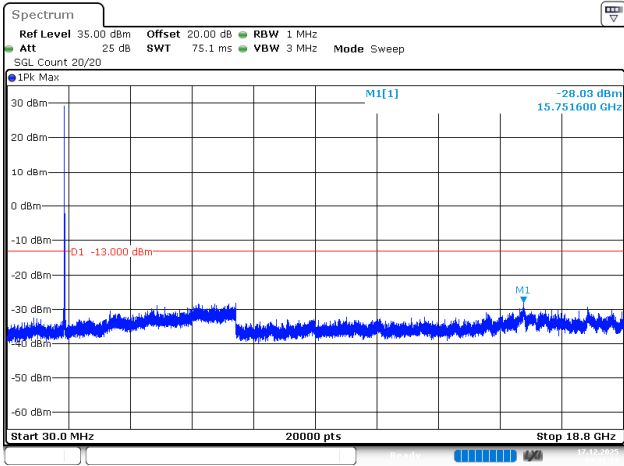


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 17.DEC.2025 09:31:32

FCC Part 27 & IC RSS-130


LTE Band 71, Normal

1RB was the worst case


5MHz_Low_QPSK_1@0(30MHz~7.98GHz)

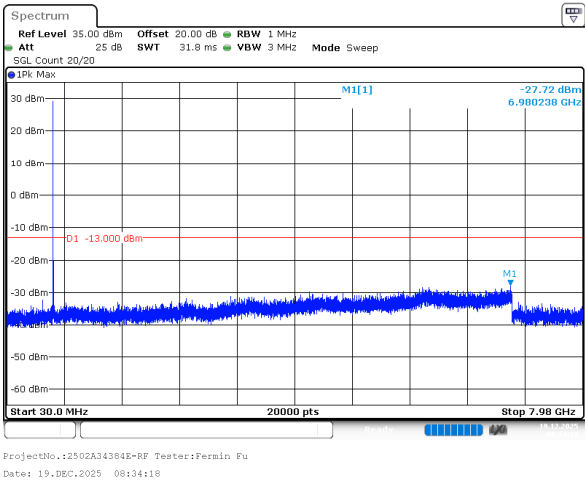


5MHz_Middle_QPSK_1@0(30MHz~7.98GHz)

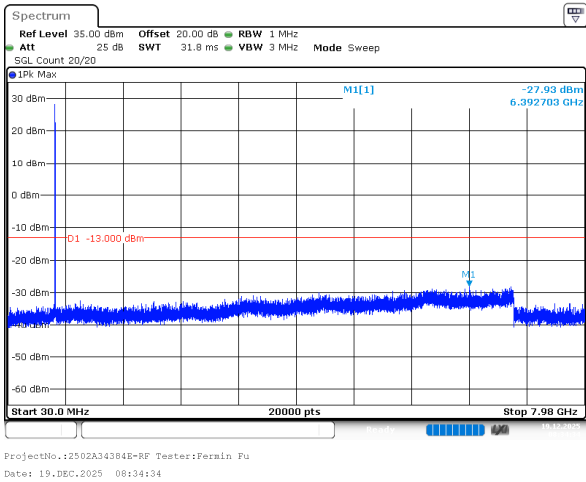


5MHz_High_QPSK_1@0(30MHz~7.98GHz)

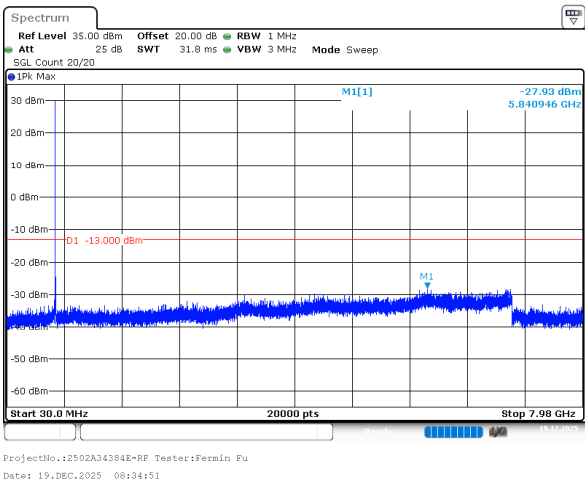


10MHz_Low_QPSK_1@0(30MHz~7.98GHz)

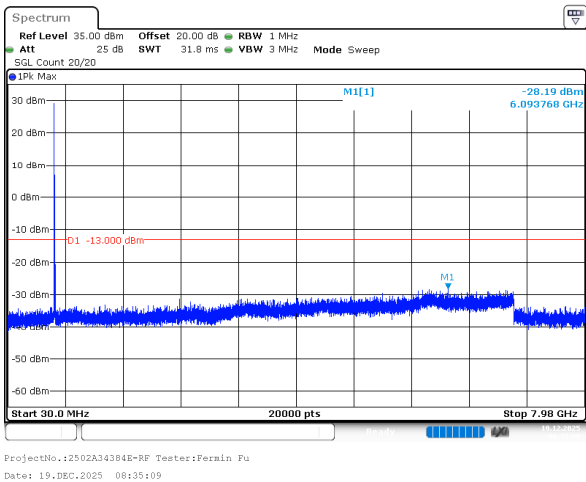


10MHz_Middle_QPSK_1@0(30MHz~7.98GHz)

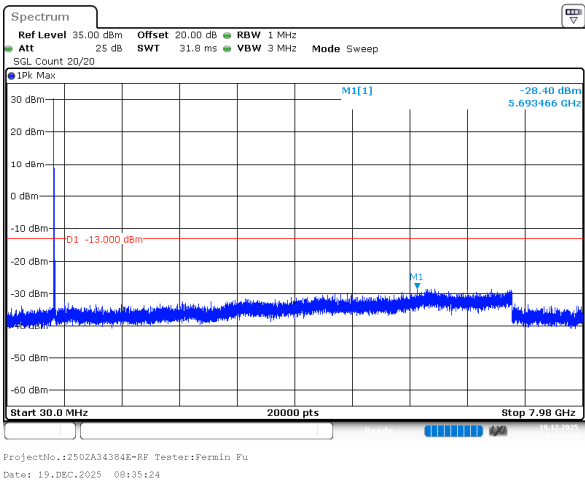

10MHz_High_QPSK_1@0(30MHz~7.98GHz)

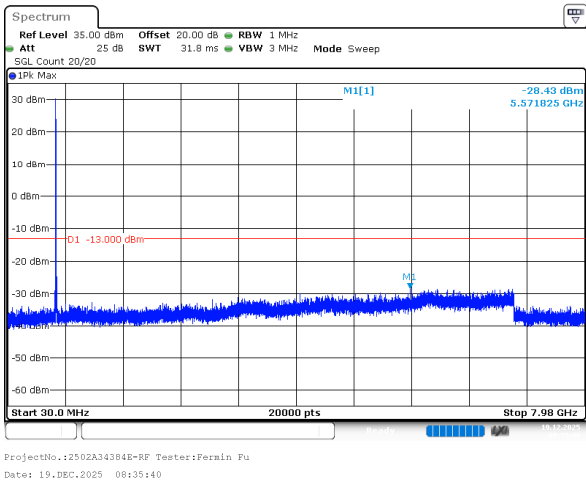


15MHz_Low_QPSK_1@0(30MHz~7.98GHz)

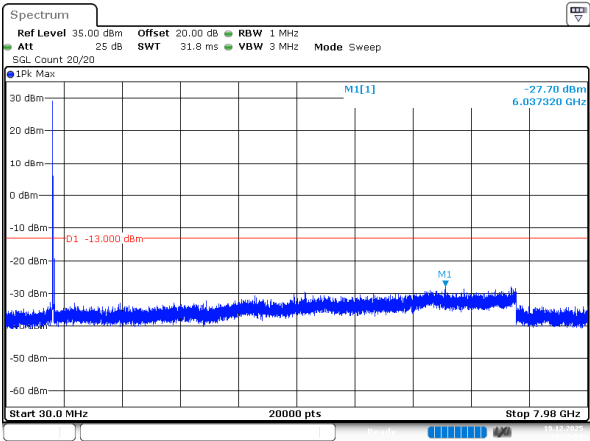


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:35:59

15MHz_Middle_QPSK_1@0(30MHz~7.98GHz)

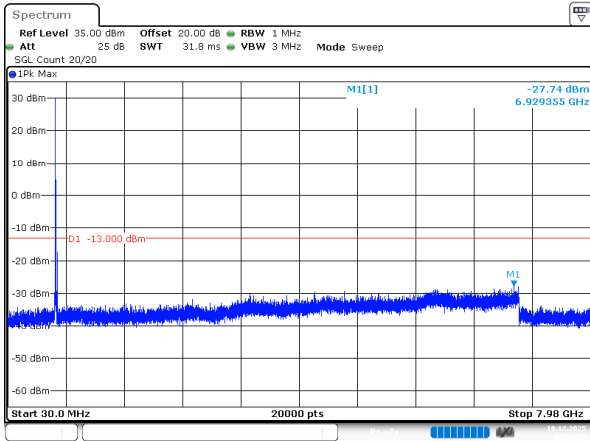


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:36:16

15MHz_High_QPSK_1@0(30MHz~7.98GHz)

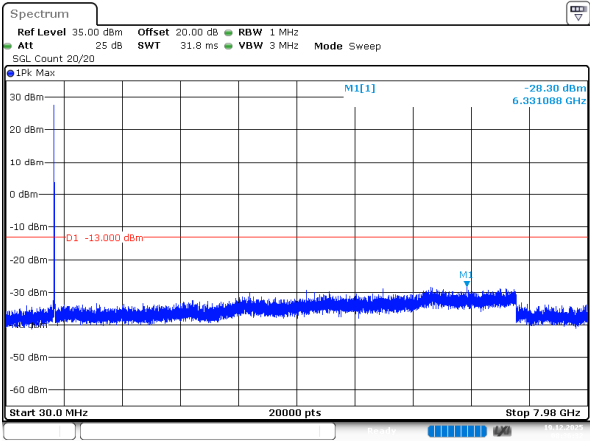


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:36:32

20MHz_Low_QPSK_1@0(30MHz~7.98GHz)

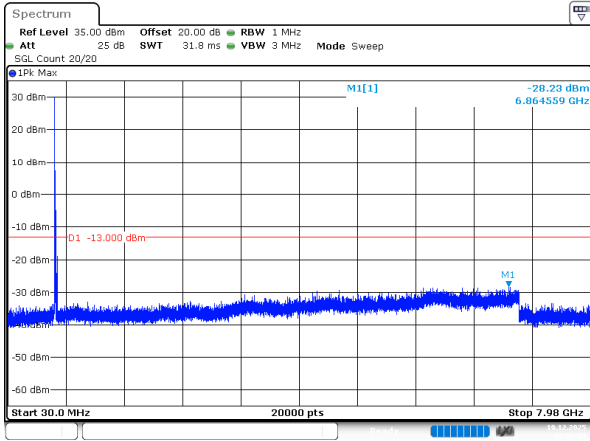


ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:36:51

20MHz_Middle_QPSK_1@0(30MHz~7.98GHz)

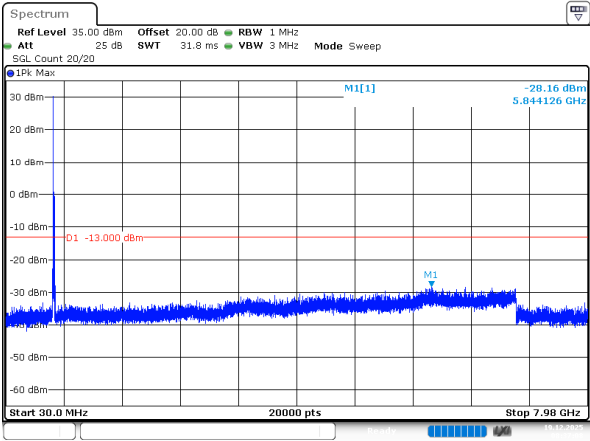

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 08:37:08

20MHz_High_QPSK_1@0(30MHz~7.98GHz)

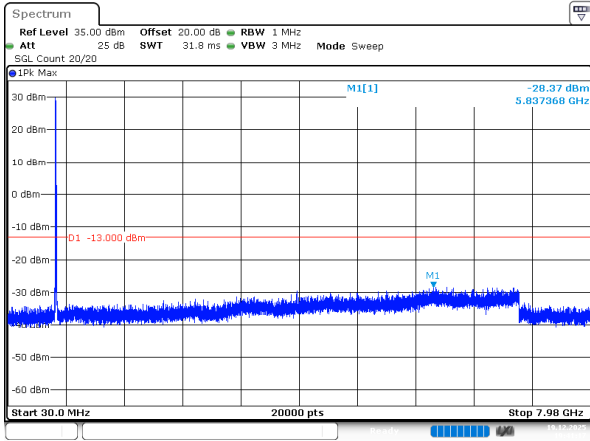

ProjectNo.:2502A34384E-RF Tester:Permin Fu
Date: 19.DEC.2025 19:41:17

***** END *****