

Appendix Test Data

Report No. : 1812C50426712501-01

Applicant : Screeneo Innovation SA

Address : 8A route de Suisse 1163 Etoy Switzerland

Product Name : Digital Projector

Report Date : 2025-09-30

Shenzhen Anbotek Compliance Laboratory Limited



Appendix Test Data


Report No.:	1812C50426712501-01	Test Sample No.:	1-2-2
Start Test Date:	2025-8-25	Finish Test Date:	2025-9-5
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	25.1C°	Relative Humidity:	48%
Pressure:	101kPa		


Appendix A: 20dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.73	2401.60	2402.33	---	---
DH5	Ant1	2441	0.72	2440.60	2441.33	---	---
DH5	Ant1	2480	0.73	2479.60	2480.33	---	---
2DH5	Ant1	2402	1.12	2401.39	2402.51	---	---
2DH5	Ant1	2441	1.11	2440.39	2441.50	---	---
2DH5	Ant1	2480	1.12	2479.38	2480.50	---	---
3DH5	Ant1	2402	1.23	2401.35	2402.57	---	---
3DH5	Ant1	2441	1.23	2440.34	2441.57	---	---
3DH5	Ant1	2480	1.25	2479.34	2480.59	---	---

Test Graphs

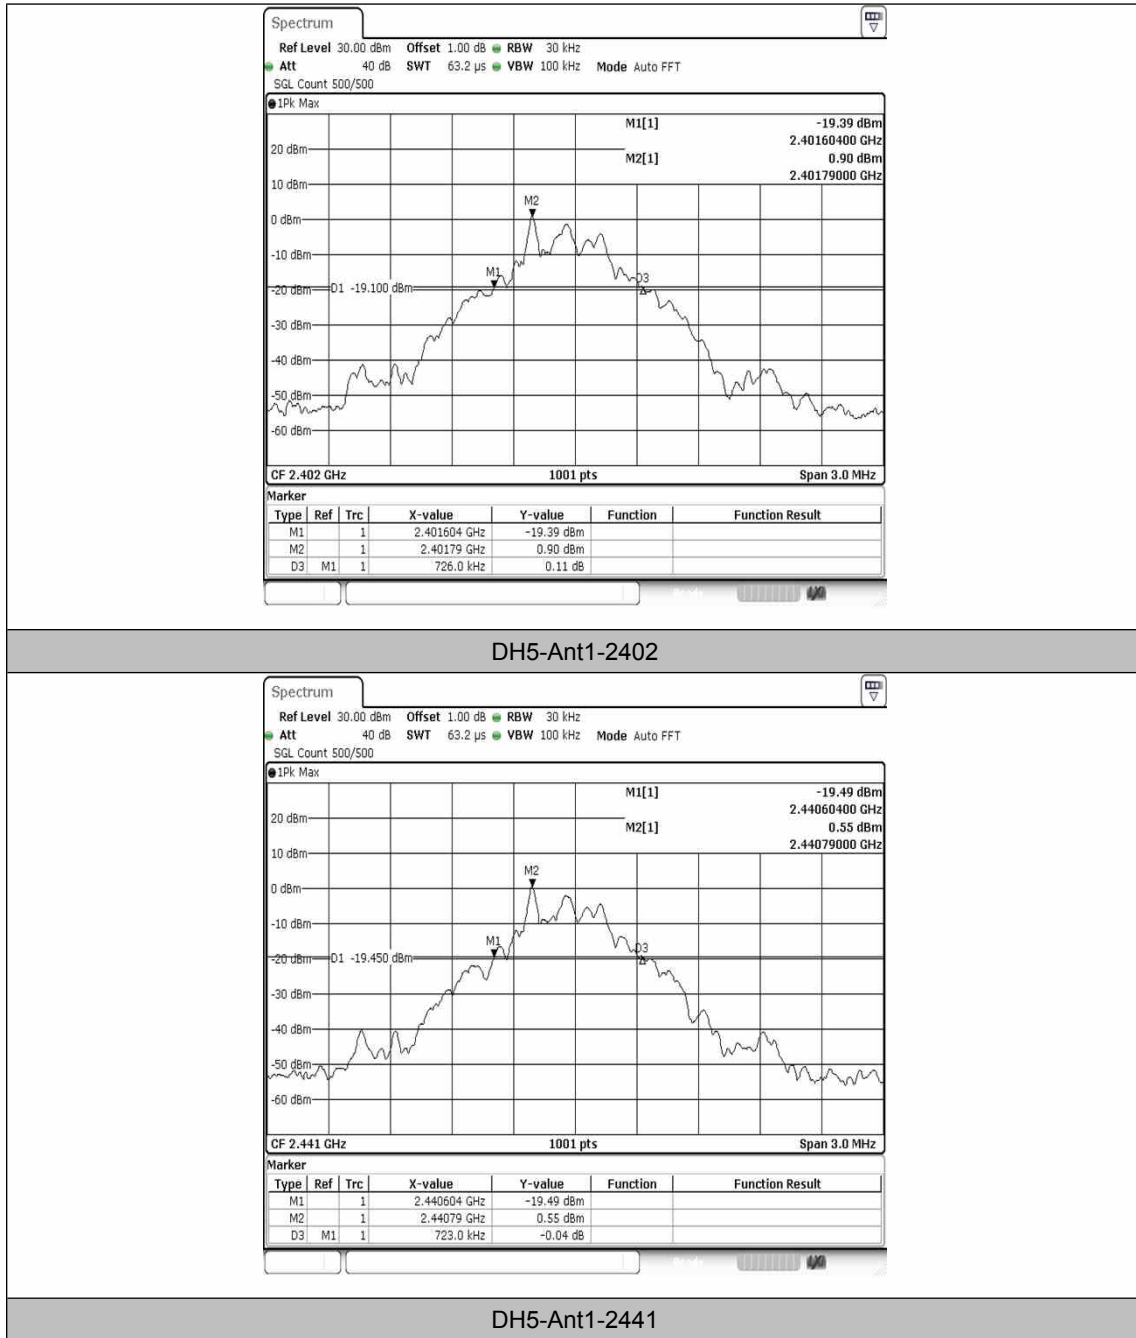


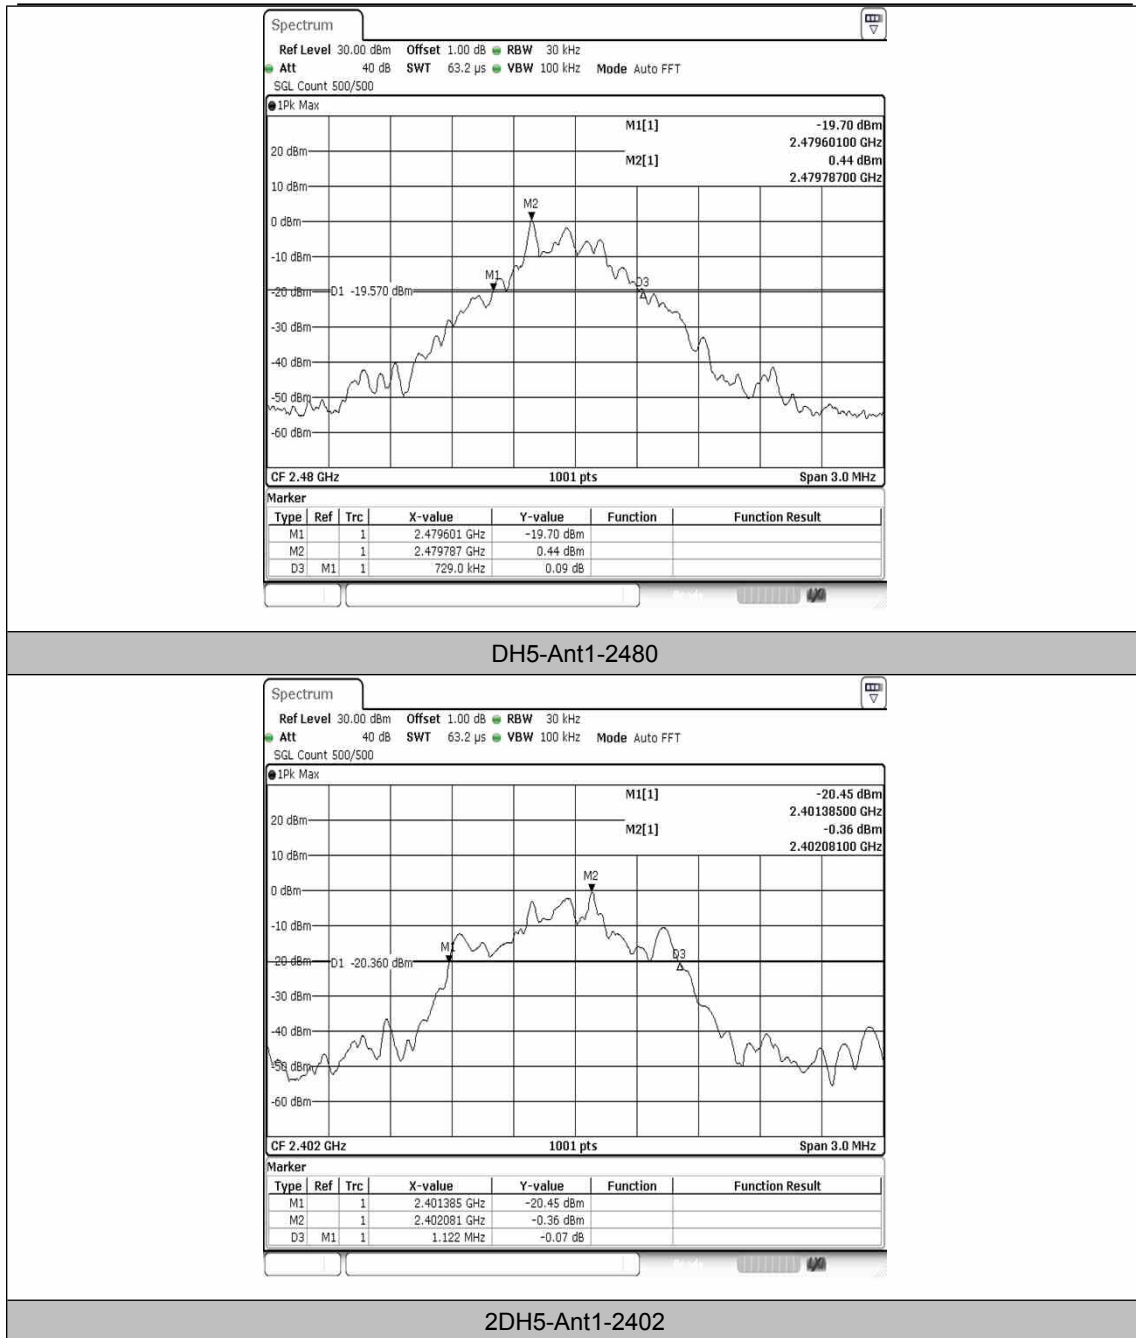

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

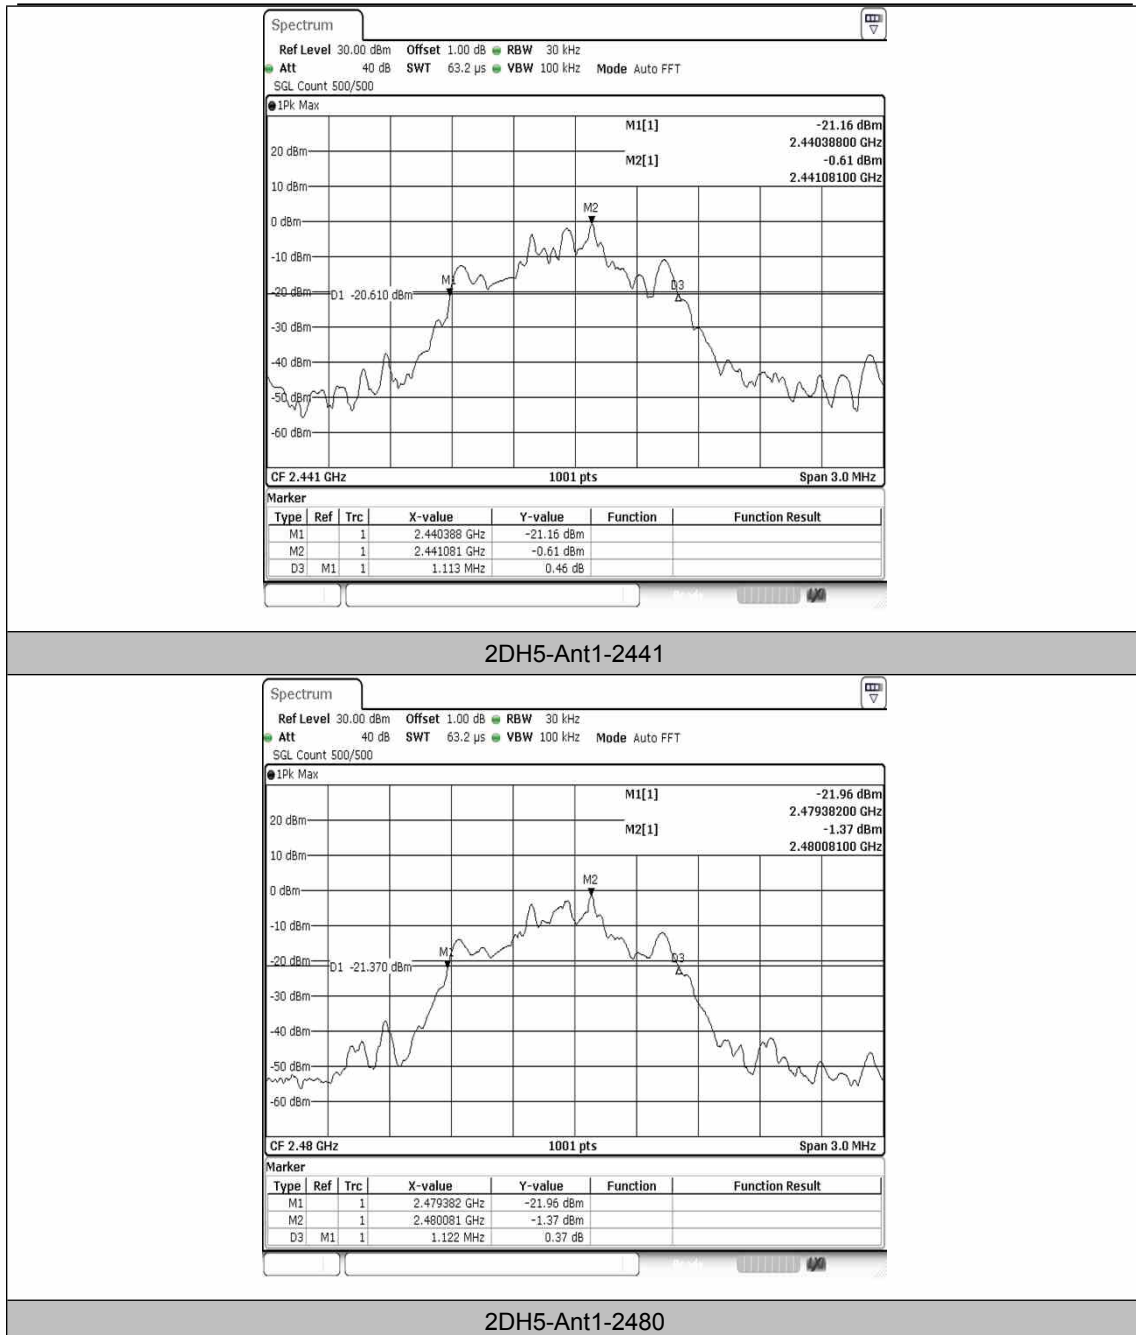

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

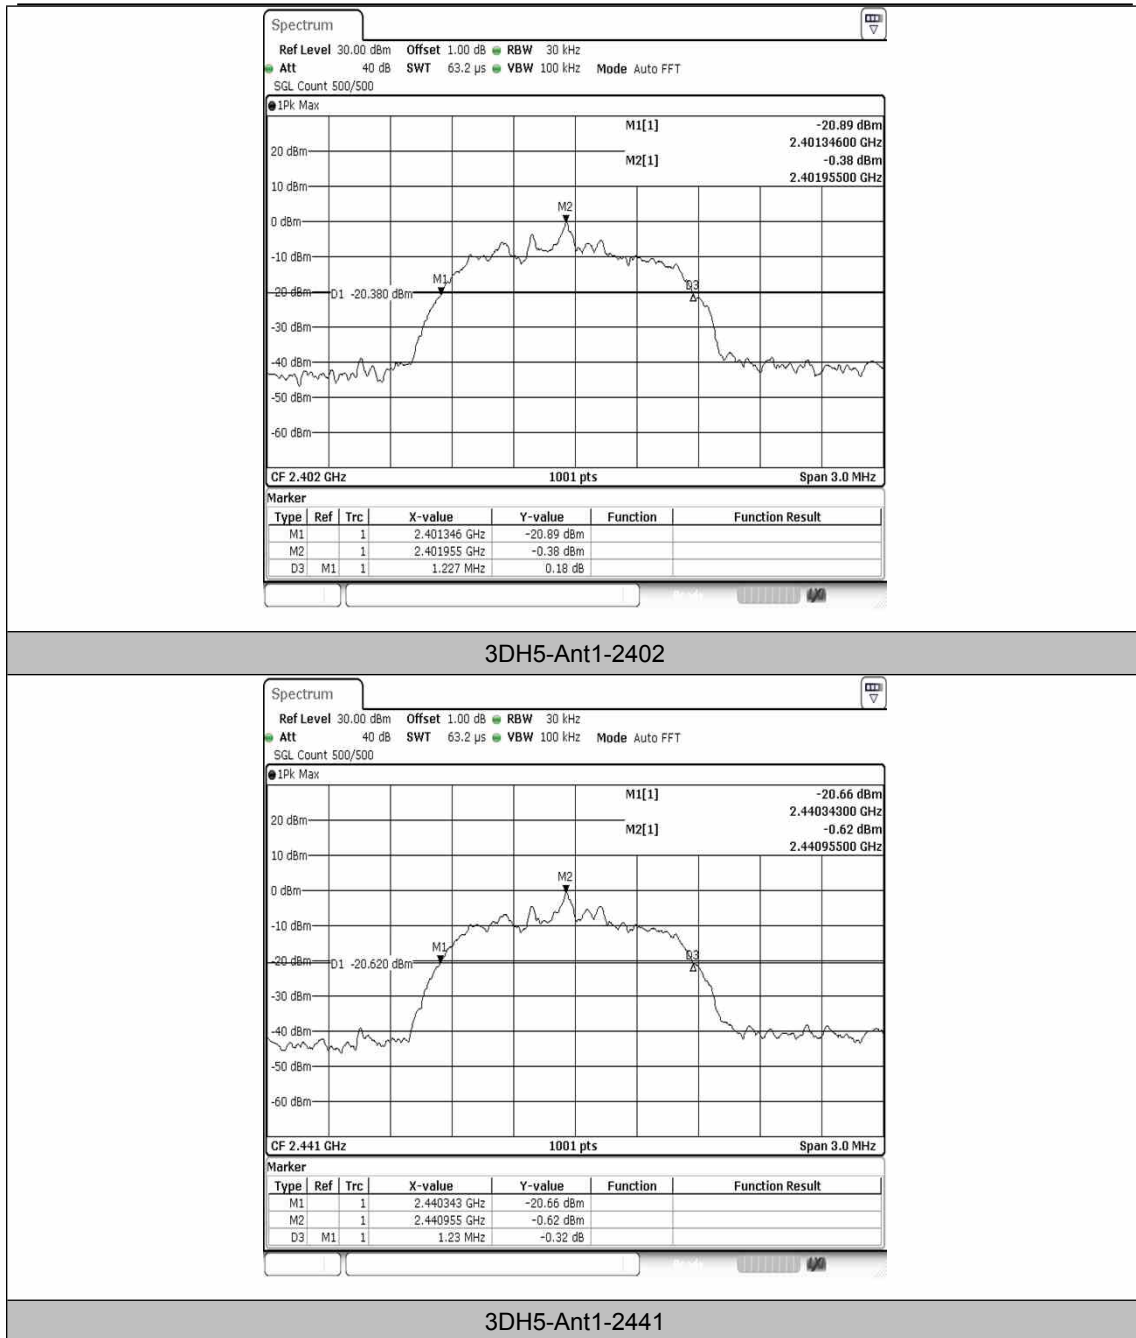

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

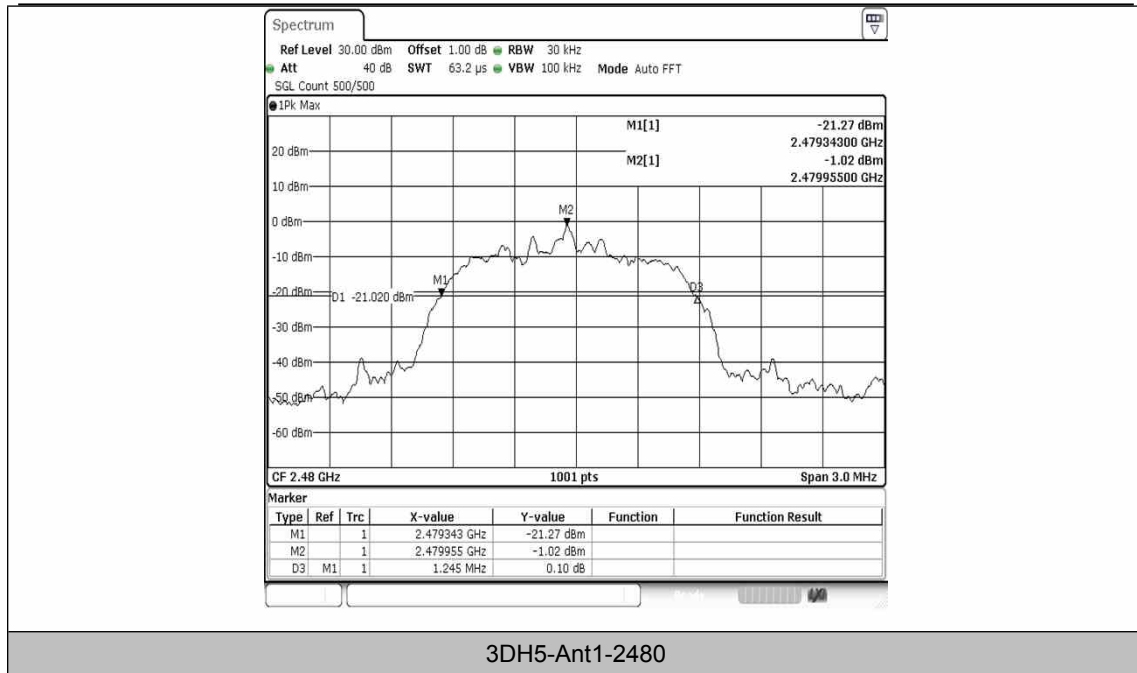

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix B: 99% Occupied Bandwidth


Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.81818	2401.5415	2402.3596	---	---
DH5	Ant1	2441	0.84515	2440.5325	2441.3776	---	---
DH5	Ant1	2480	0.83916	2479.5355	2480.3746	---	---
2DH5	Ant1	2402	1.0609	2401.4096	2402.4705	---	---
2DH5	Ant1	2441	1.0699	2440.4096	2441.4795	---	---
2DH5	Ant1	2480	1.0699	2479.4096	2480.4795	---	---
3DH5	Ant1	2402	1.1658	2401.3796	2402.5455	---	---
3DH5	Ant1	2441	1.1748	2440.3766	2441.5514	---	---
3DH5	Ant1	2480	1.1568	2479.3856	2480.5425	---	---

Test Graphs

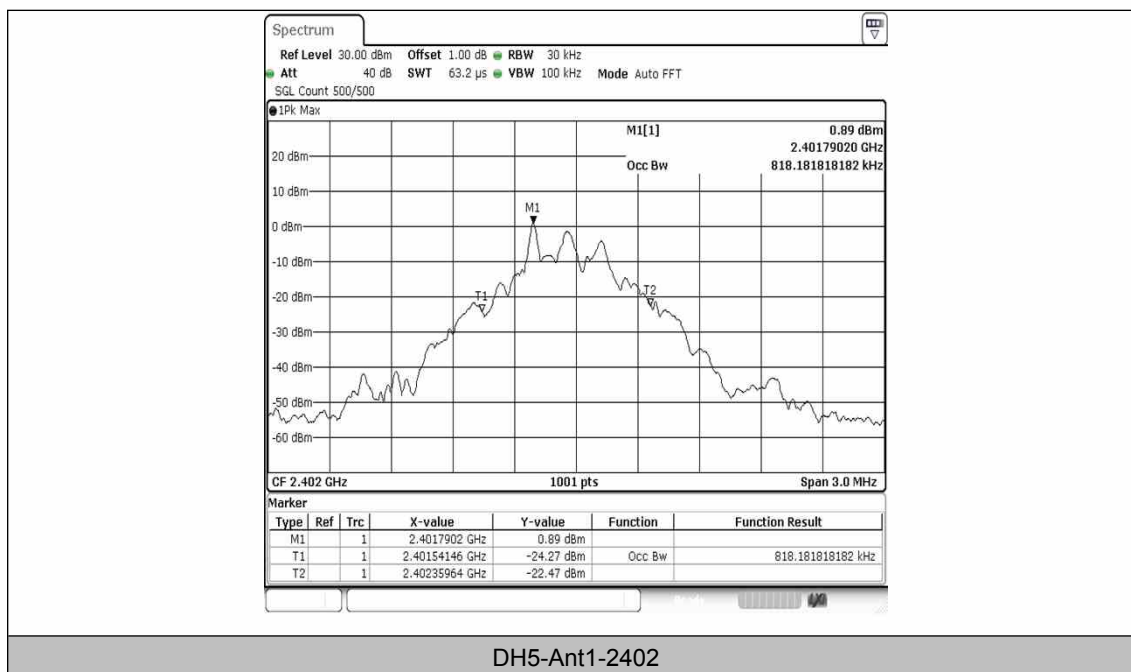

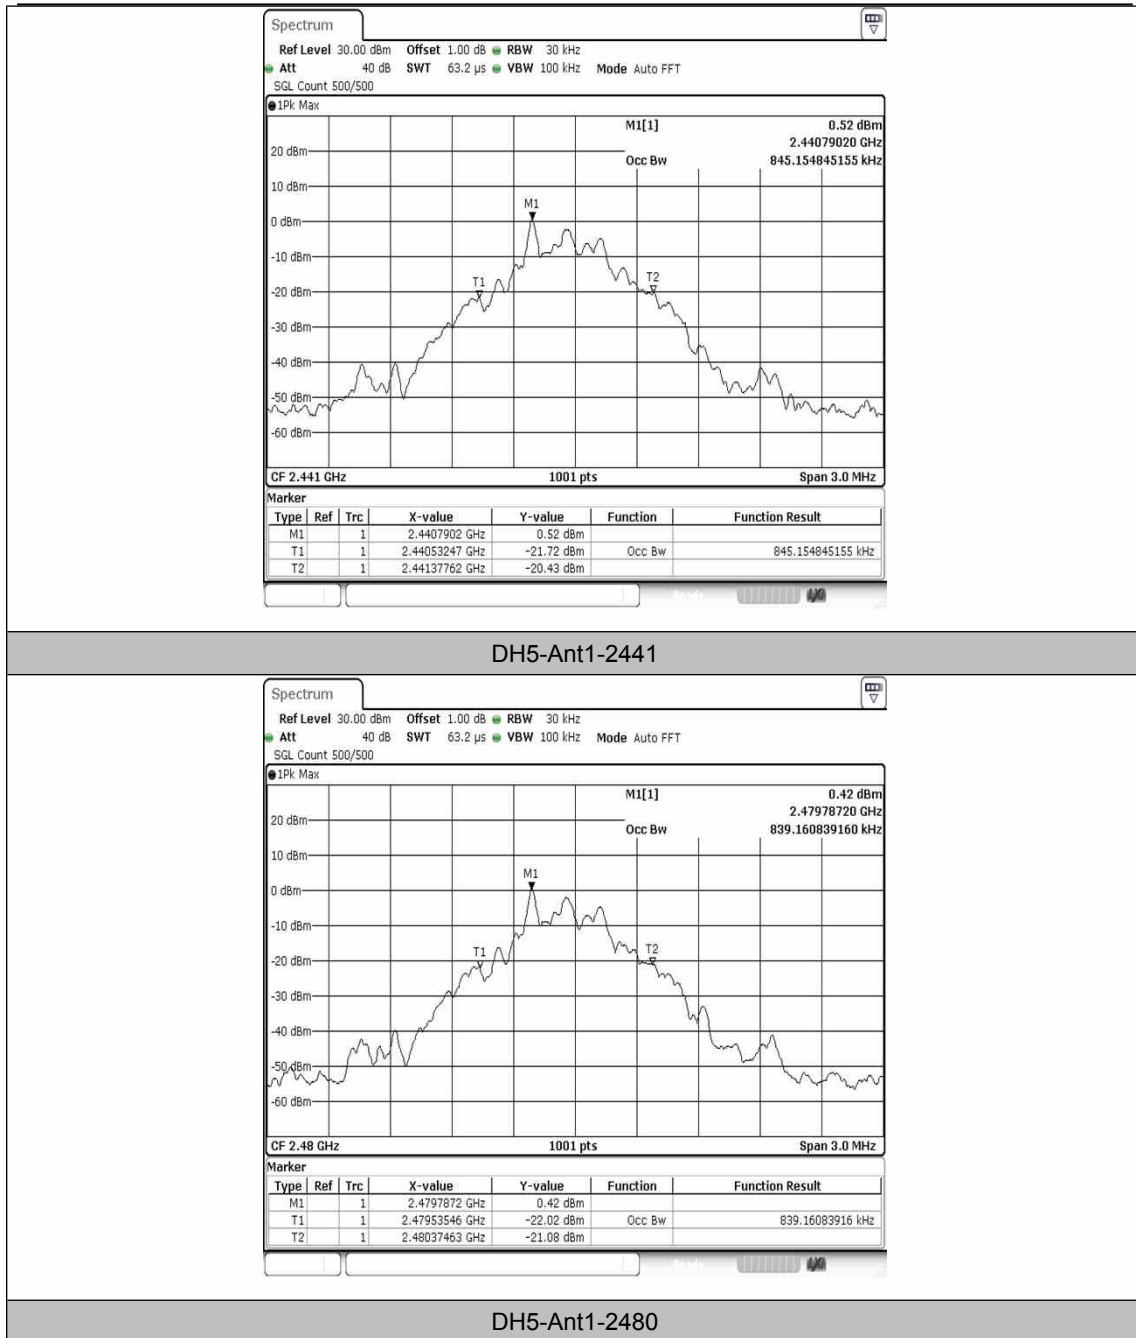


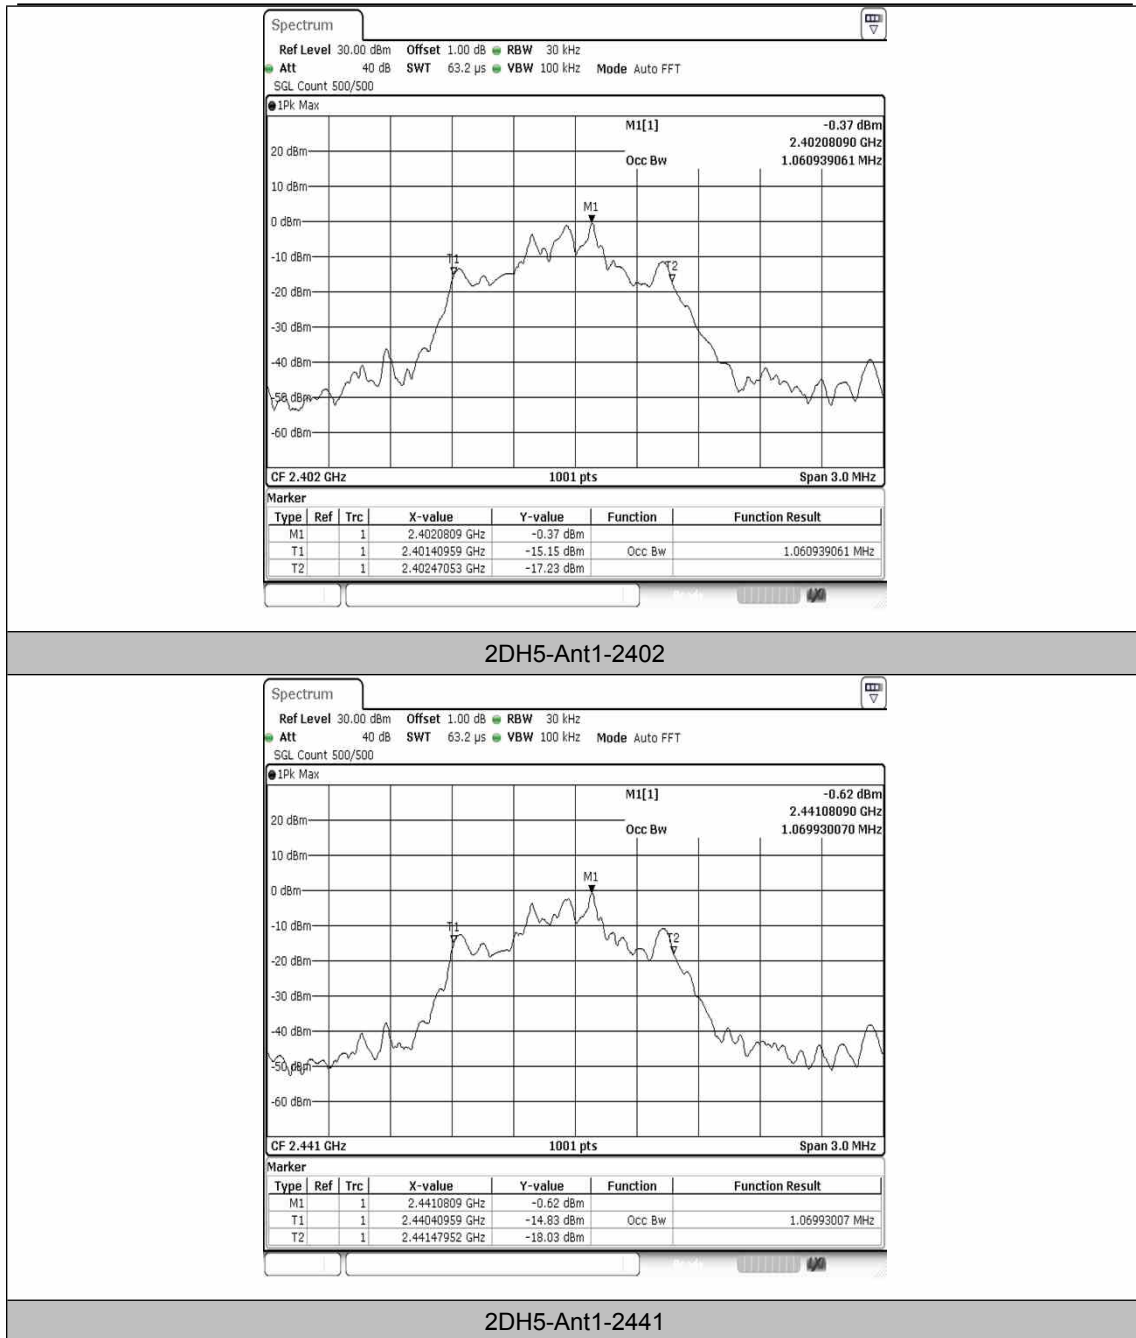

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

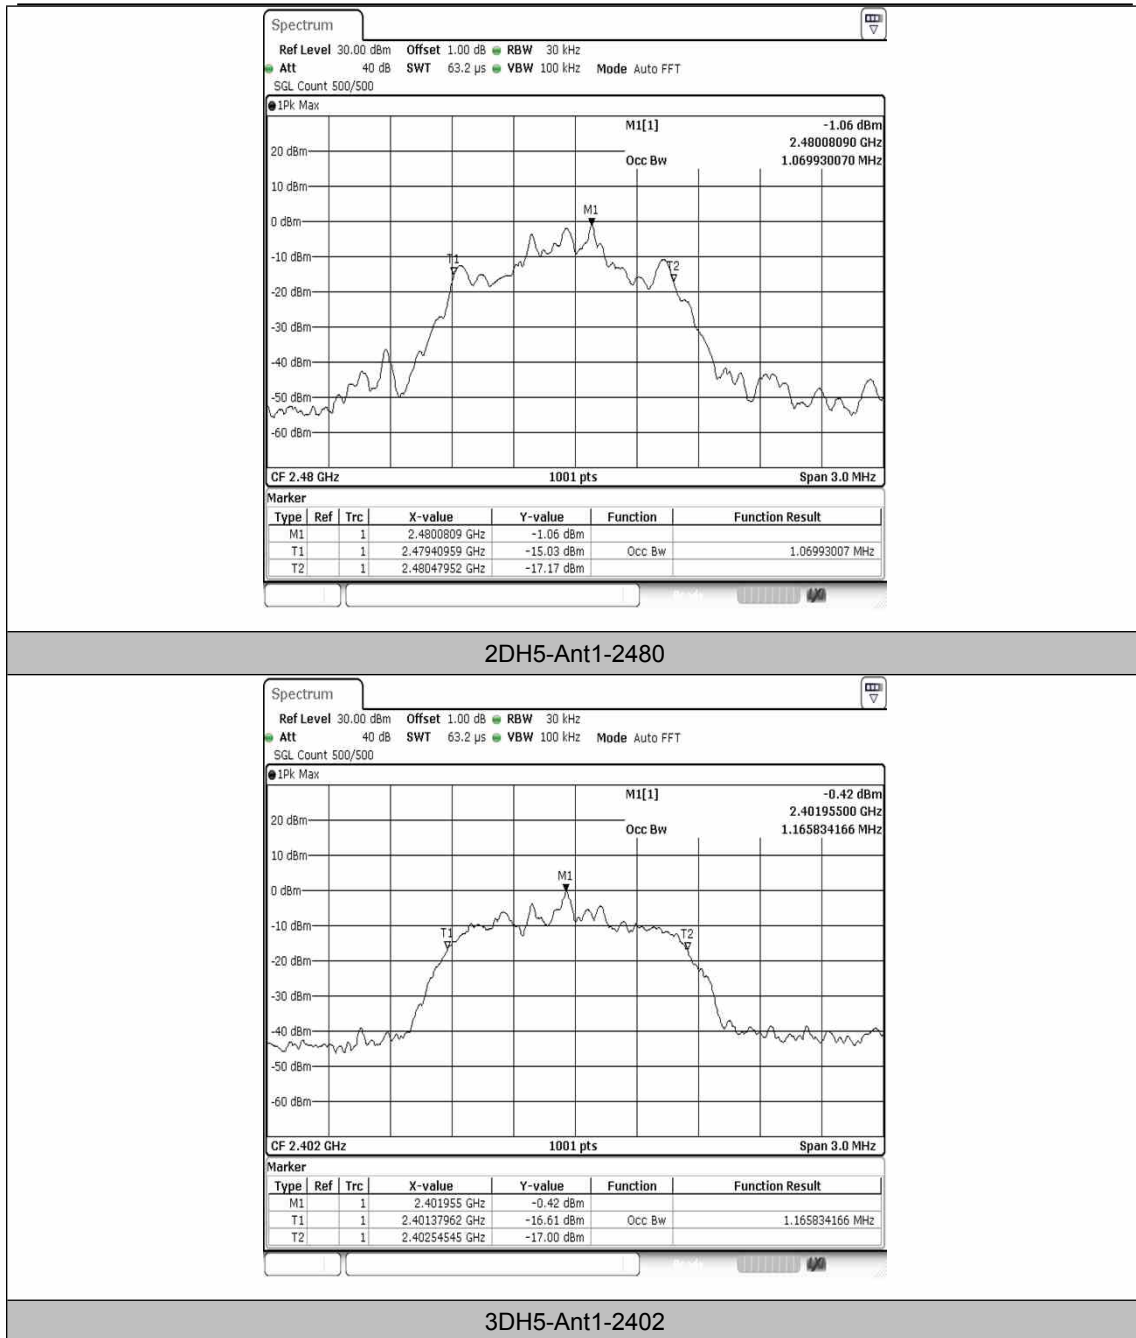

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

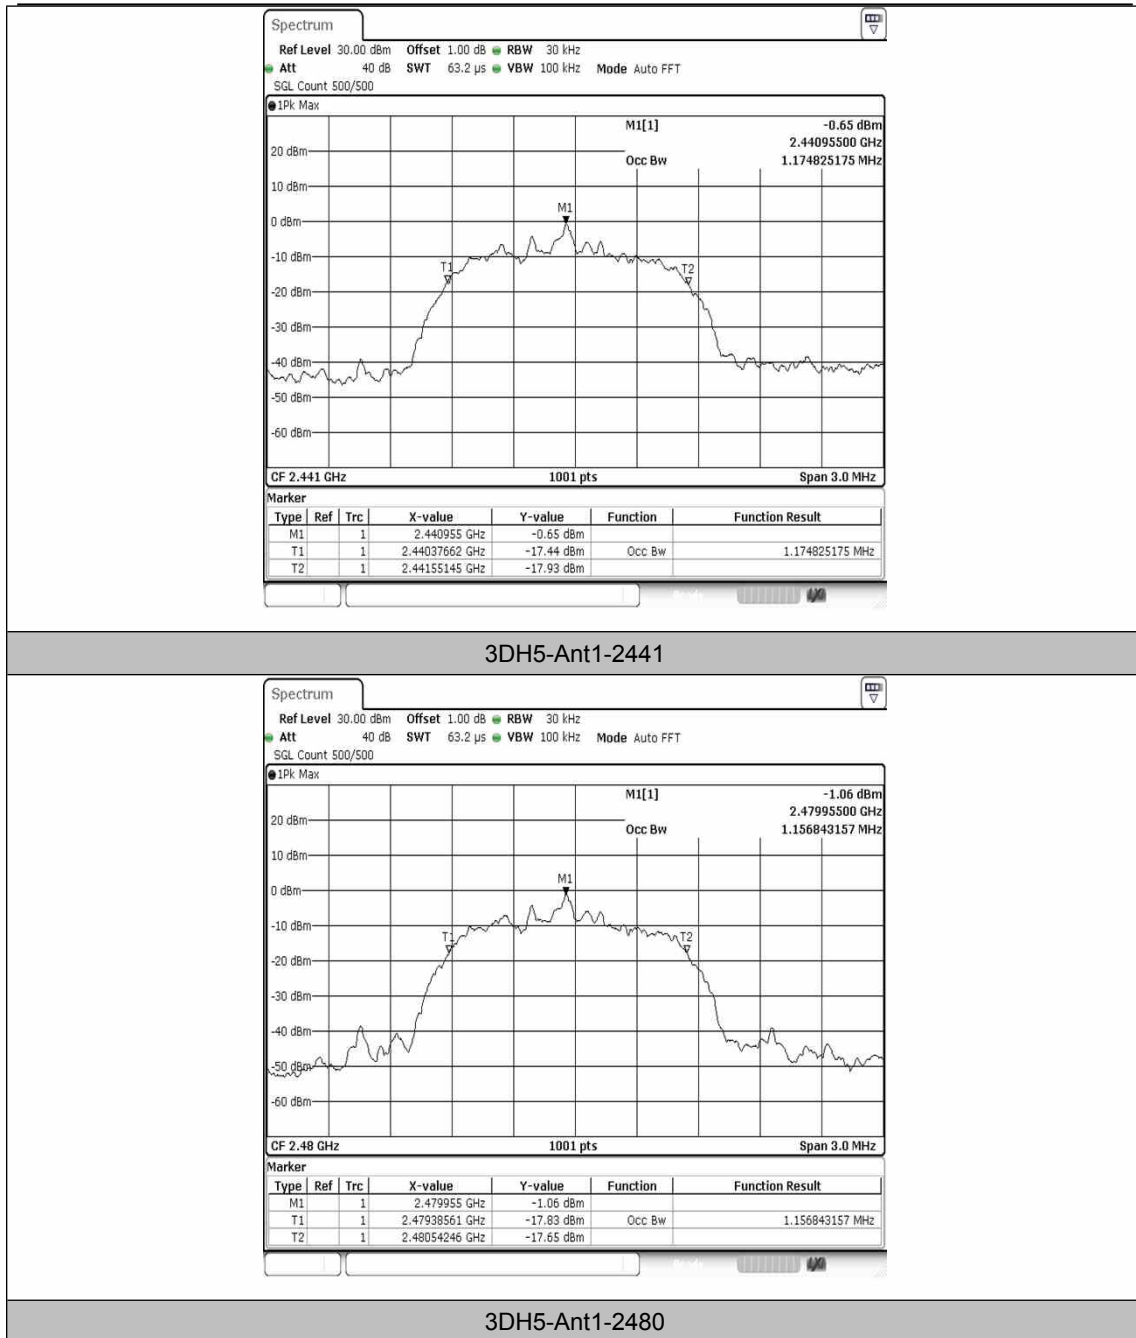

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Peak

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	1.07	≤20.97	PASS
DH5	Ant1	2441	0.72	≤20.97	PASS
DH5	Ant1	2480	0.65	≤20.97	PASS
2DH5	Ant1	2402	1.03	≤20.97	PASS
2DH5	Ant1	2441	0.75	≤20.97	PASS
2DH5	Ant1	2480	0.56	≤20.97	PASS
3DH5	Ant1	2402	1.30	≤20.97	PASS
3DH5	Ant1	2441	0.69	≤20.97	PASS
3DH5	Ant1	2480	1.12	≤20.97	PASS

Test Graphs

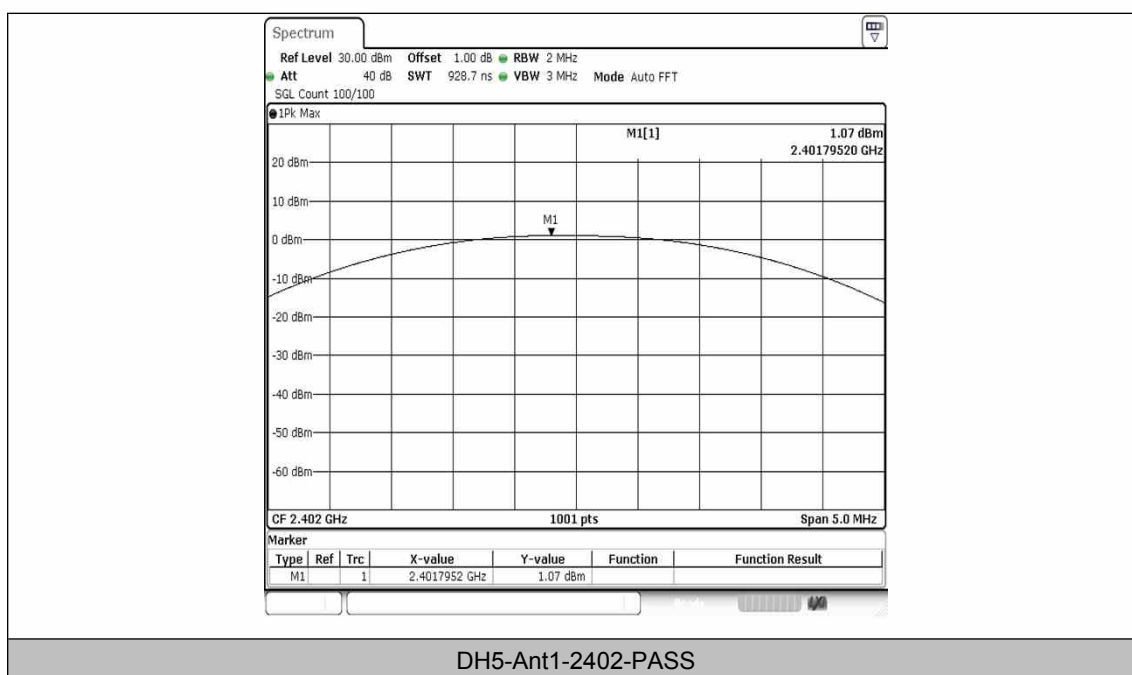


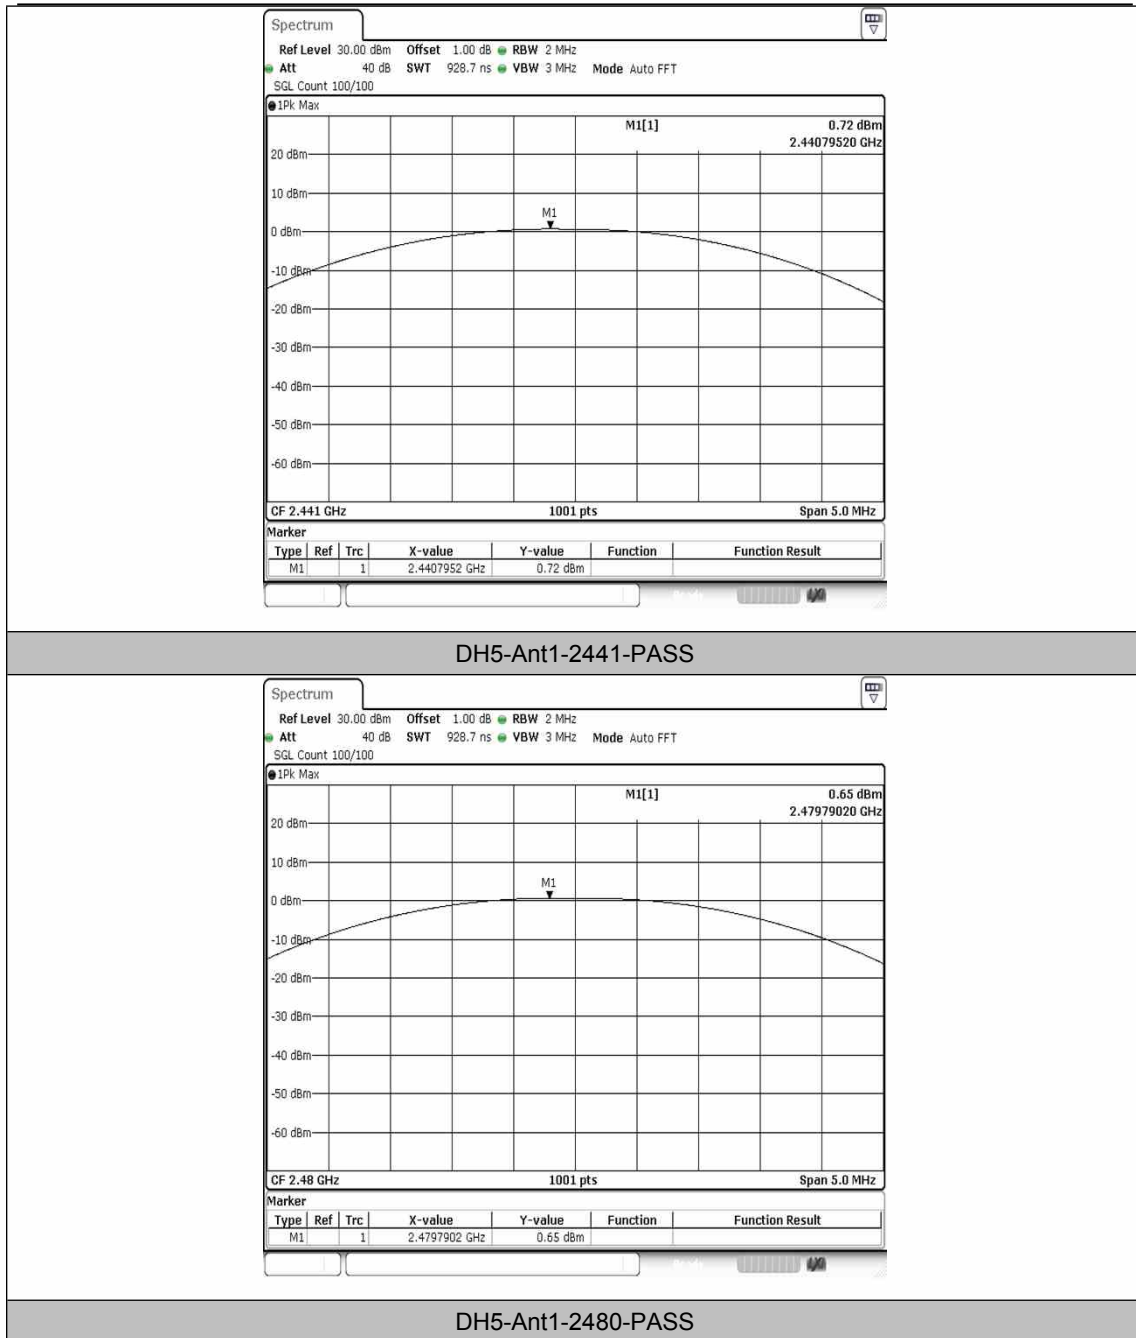

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

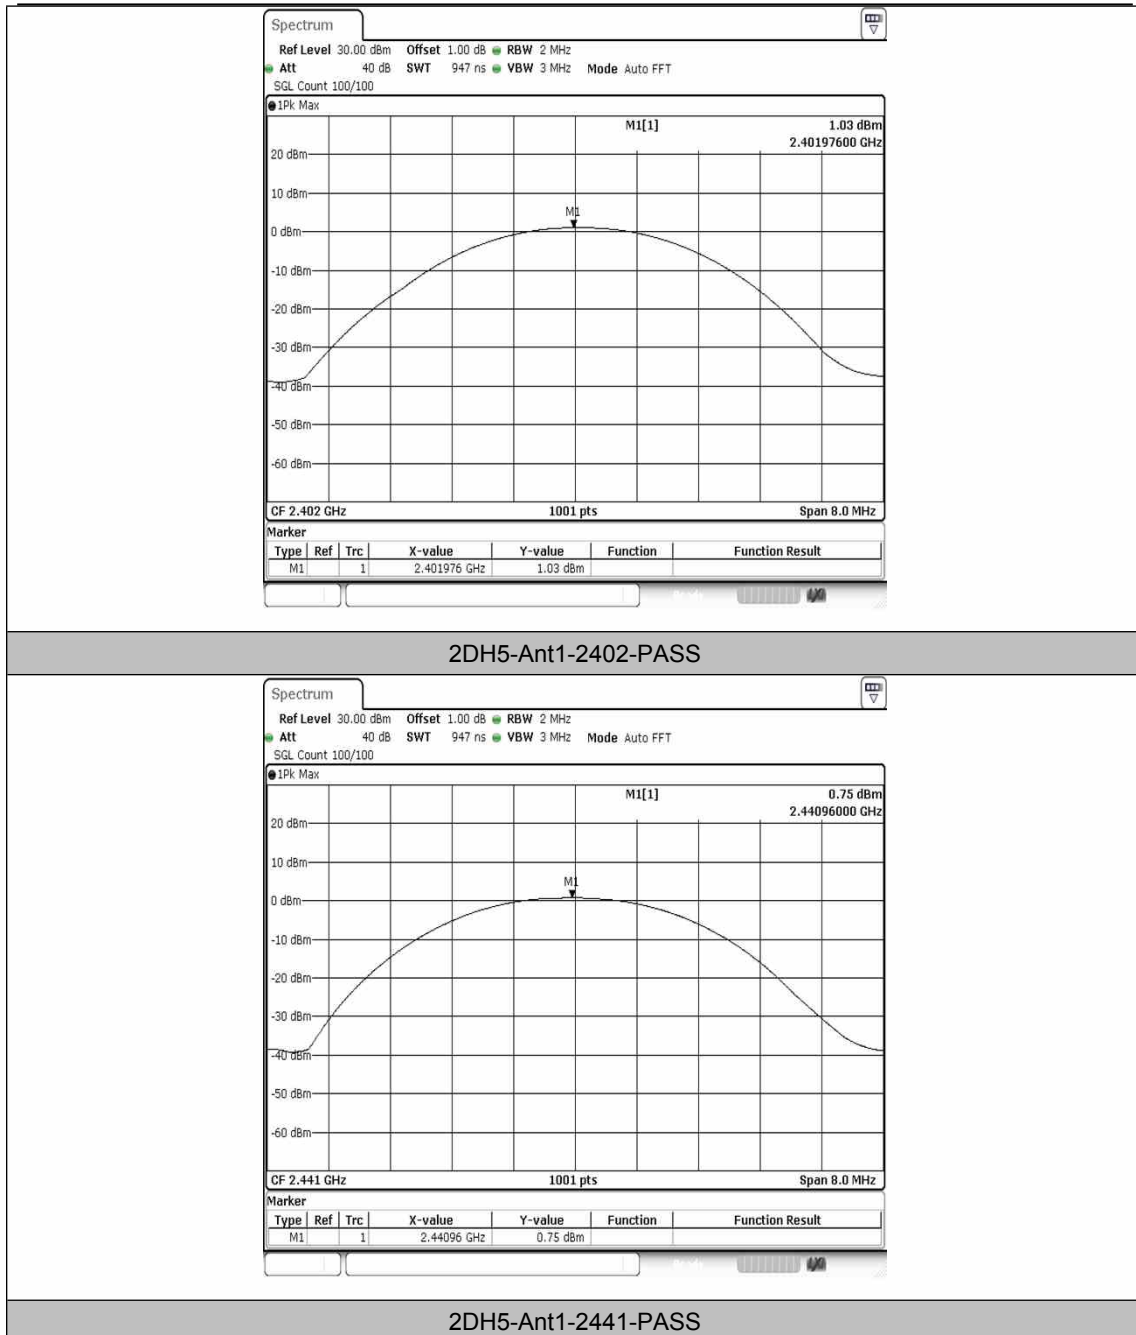

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

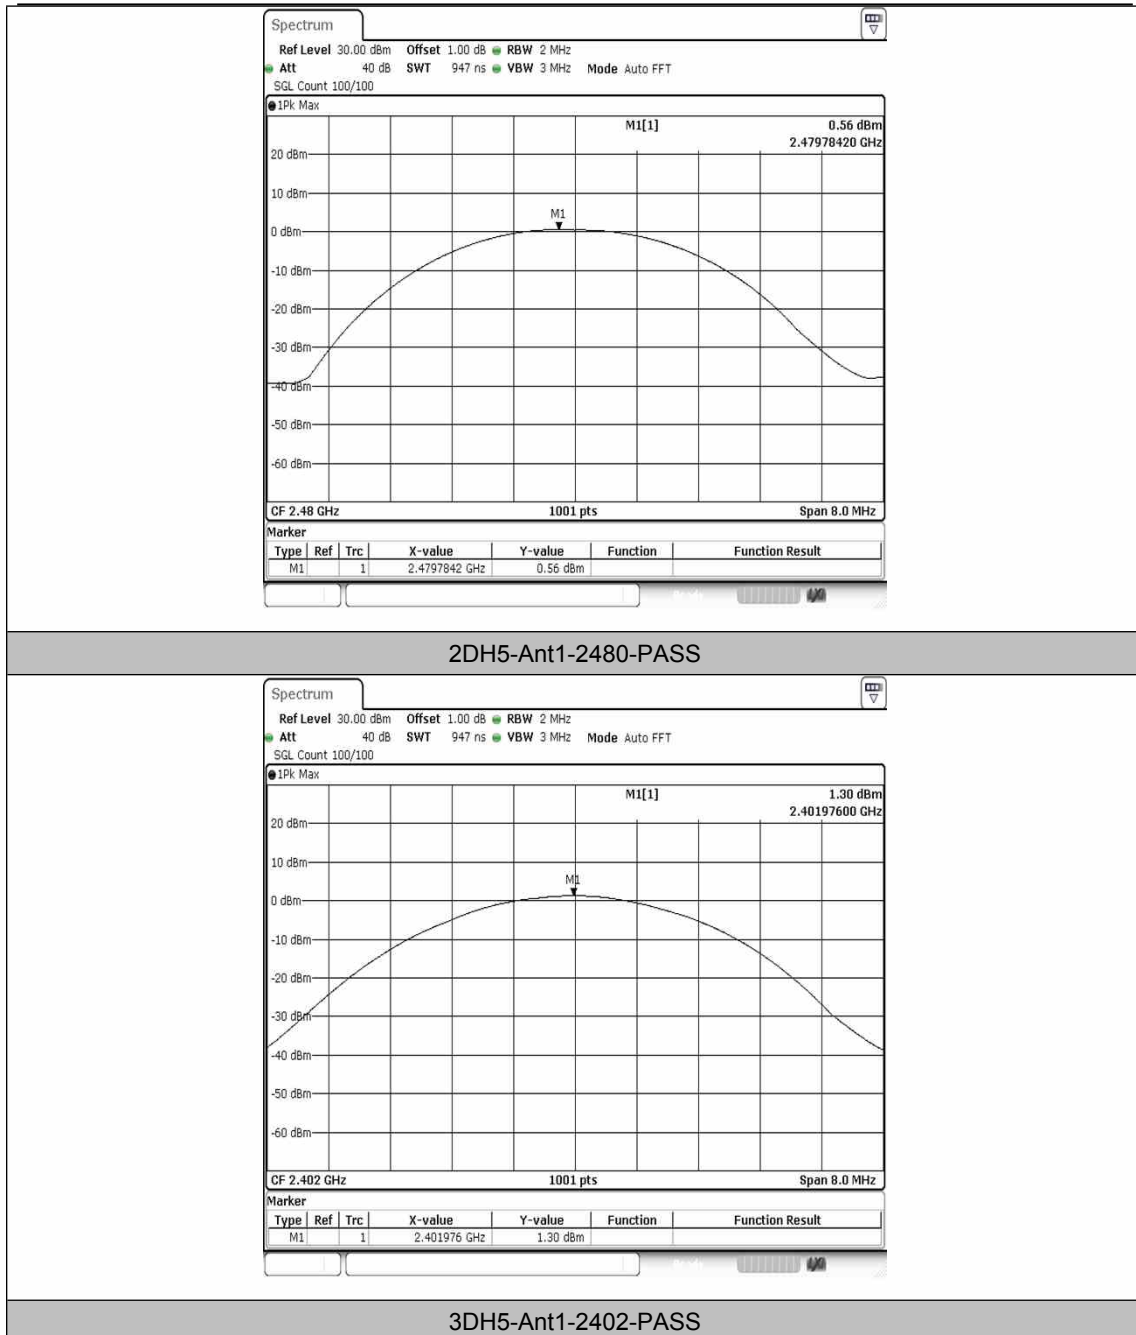

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

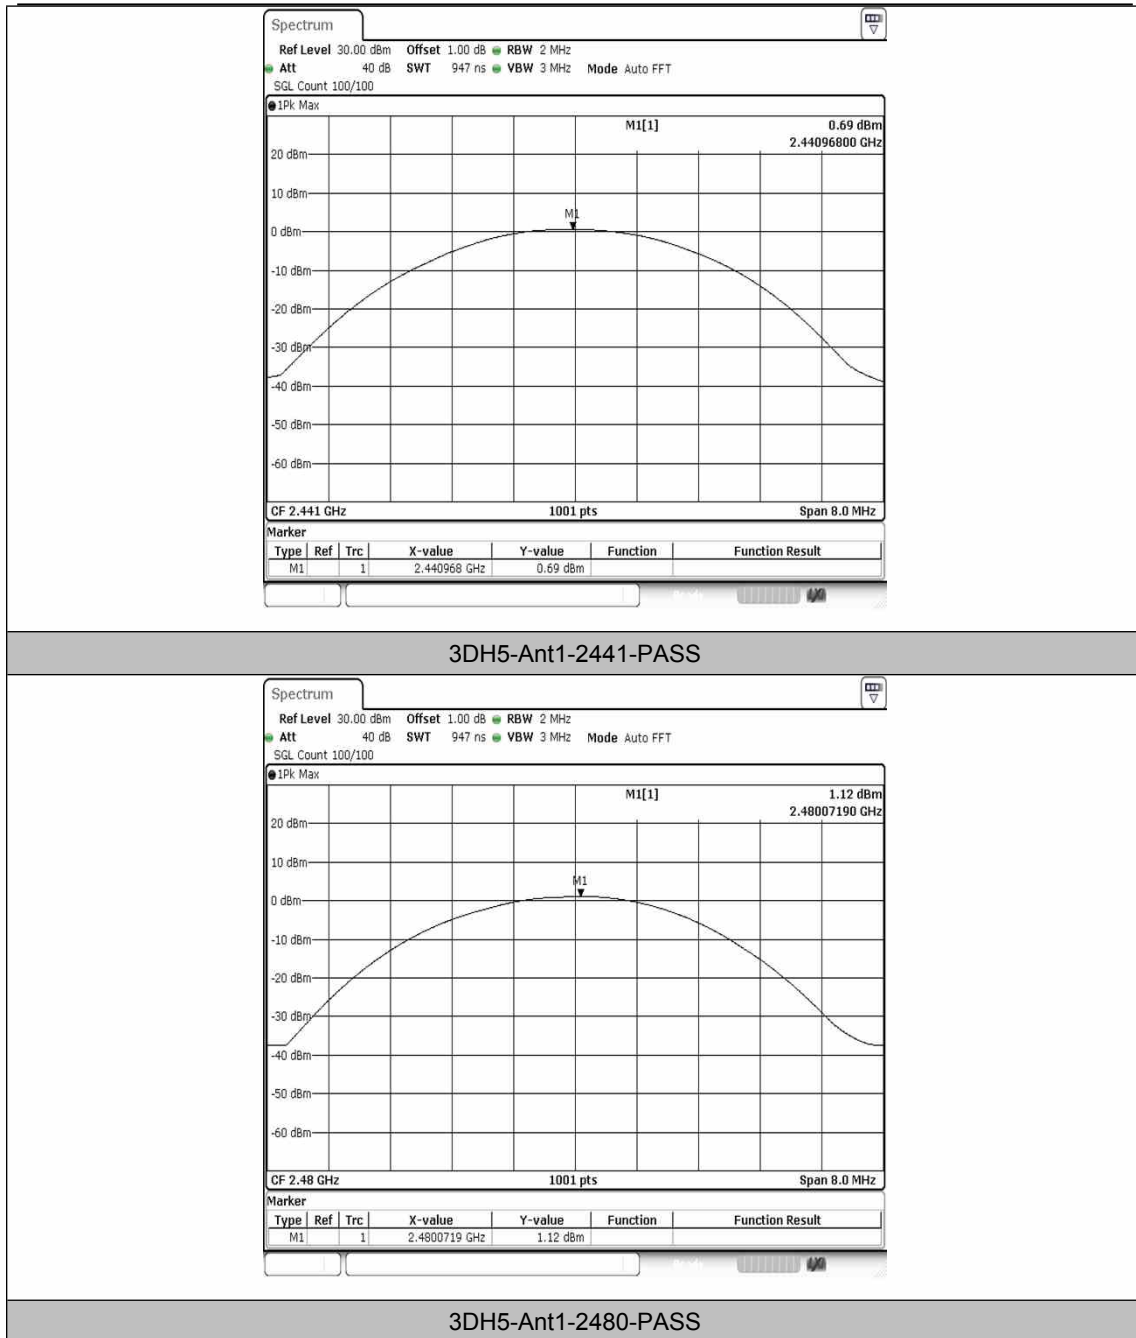

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix D: Carrier frequency separation

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	1.003	≥ 0.730	PASS
2DH5	Ant1	Hop	0.994	≥ 0.747	PASS
3DH5	Ant1	Hop	1.000	≥ 0.833	PASS

Test Graphs

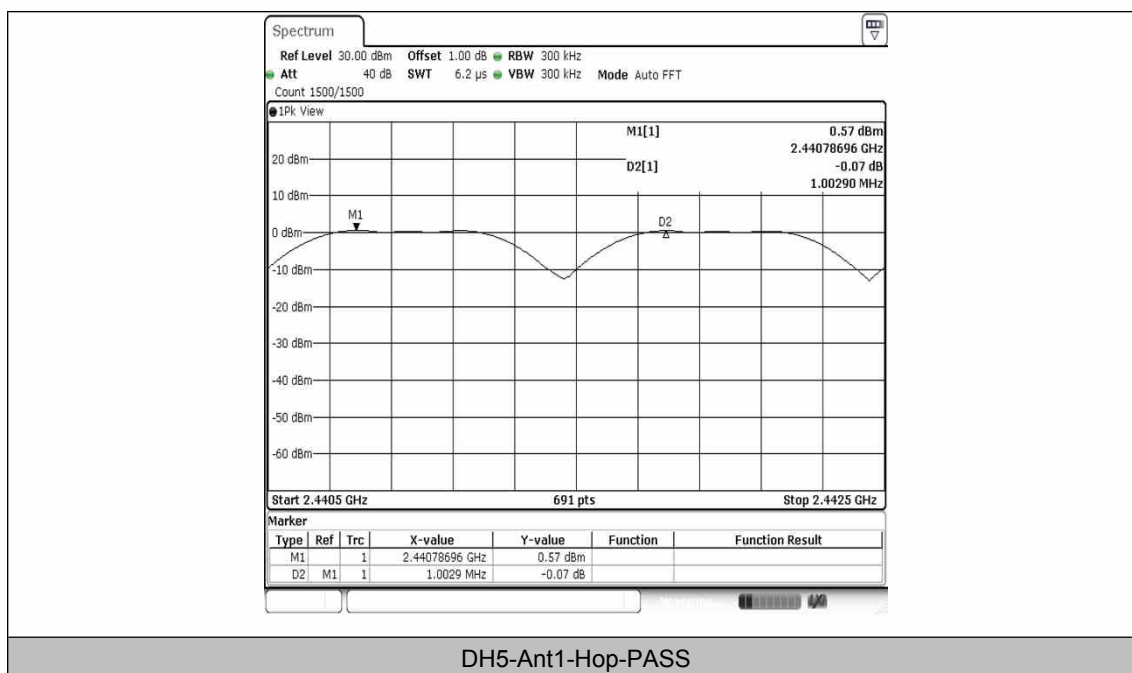

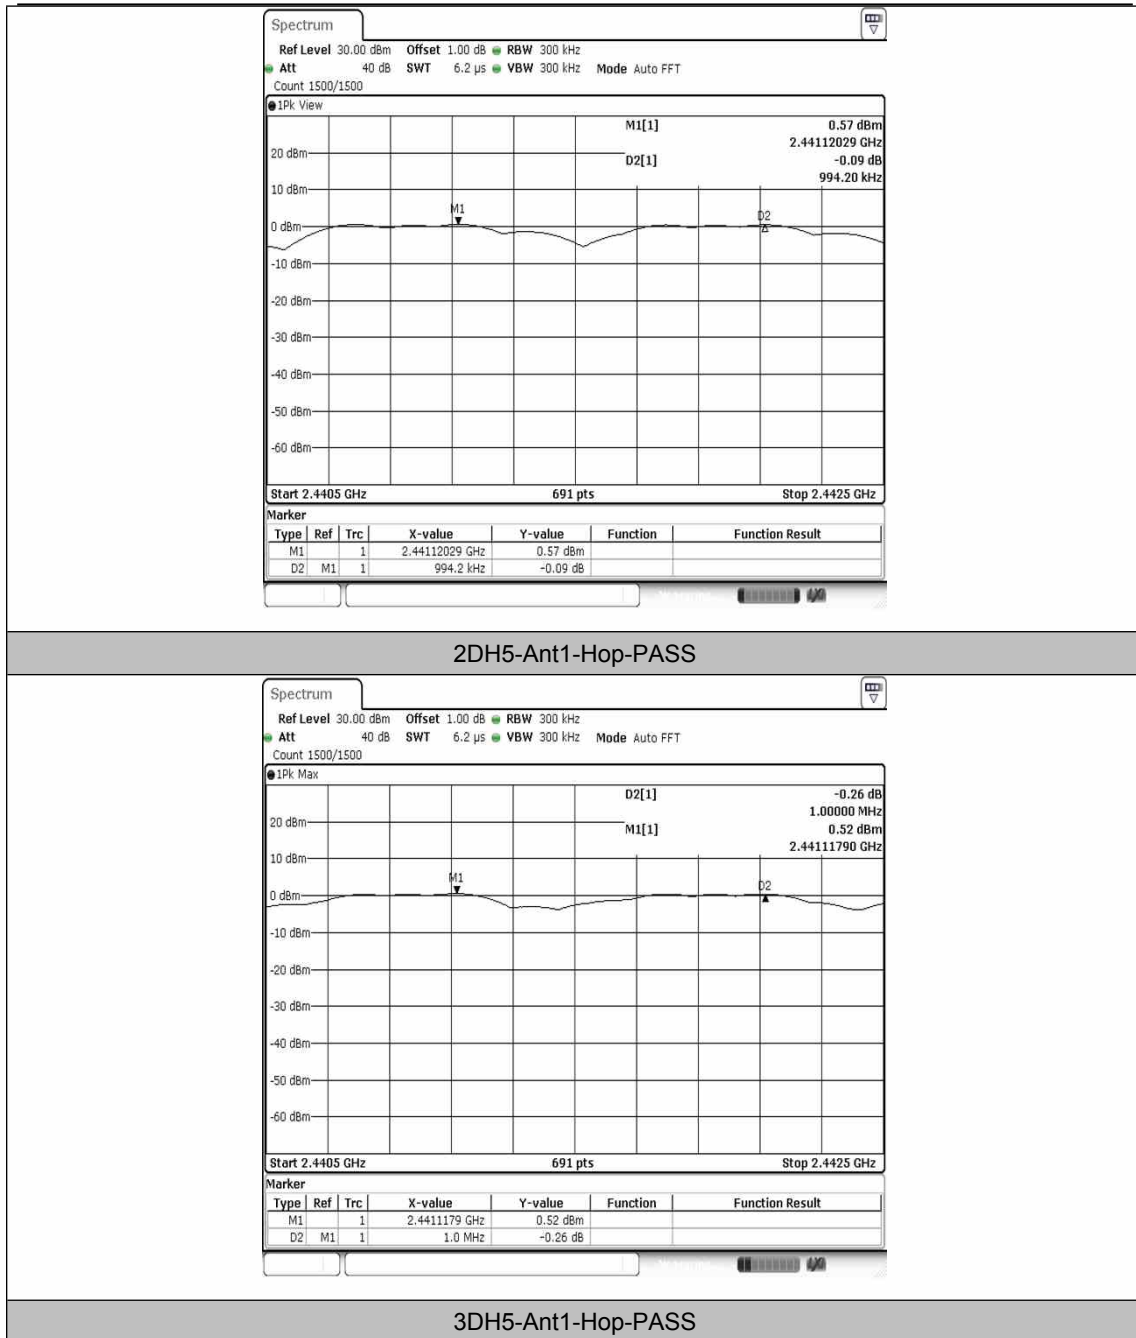

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

Appendix E: Dwell Time

Test Result

Test Mode	Antenna	Frequency [MHz]	Burst Width [ms]	Total Hops [Num]	Result [s]	Limit [s]	Verdict
DH5	Ant1	Hop	2.909	121	0.352	≤0.4	PASS
2DH5	Ant1	Hop	2.914	97	0.283	≤0.4	PASS
3DH5	Ant1	Hop	2.918	98	0.286	≤0.4	PASS


Test Graphs

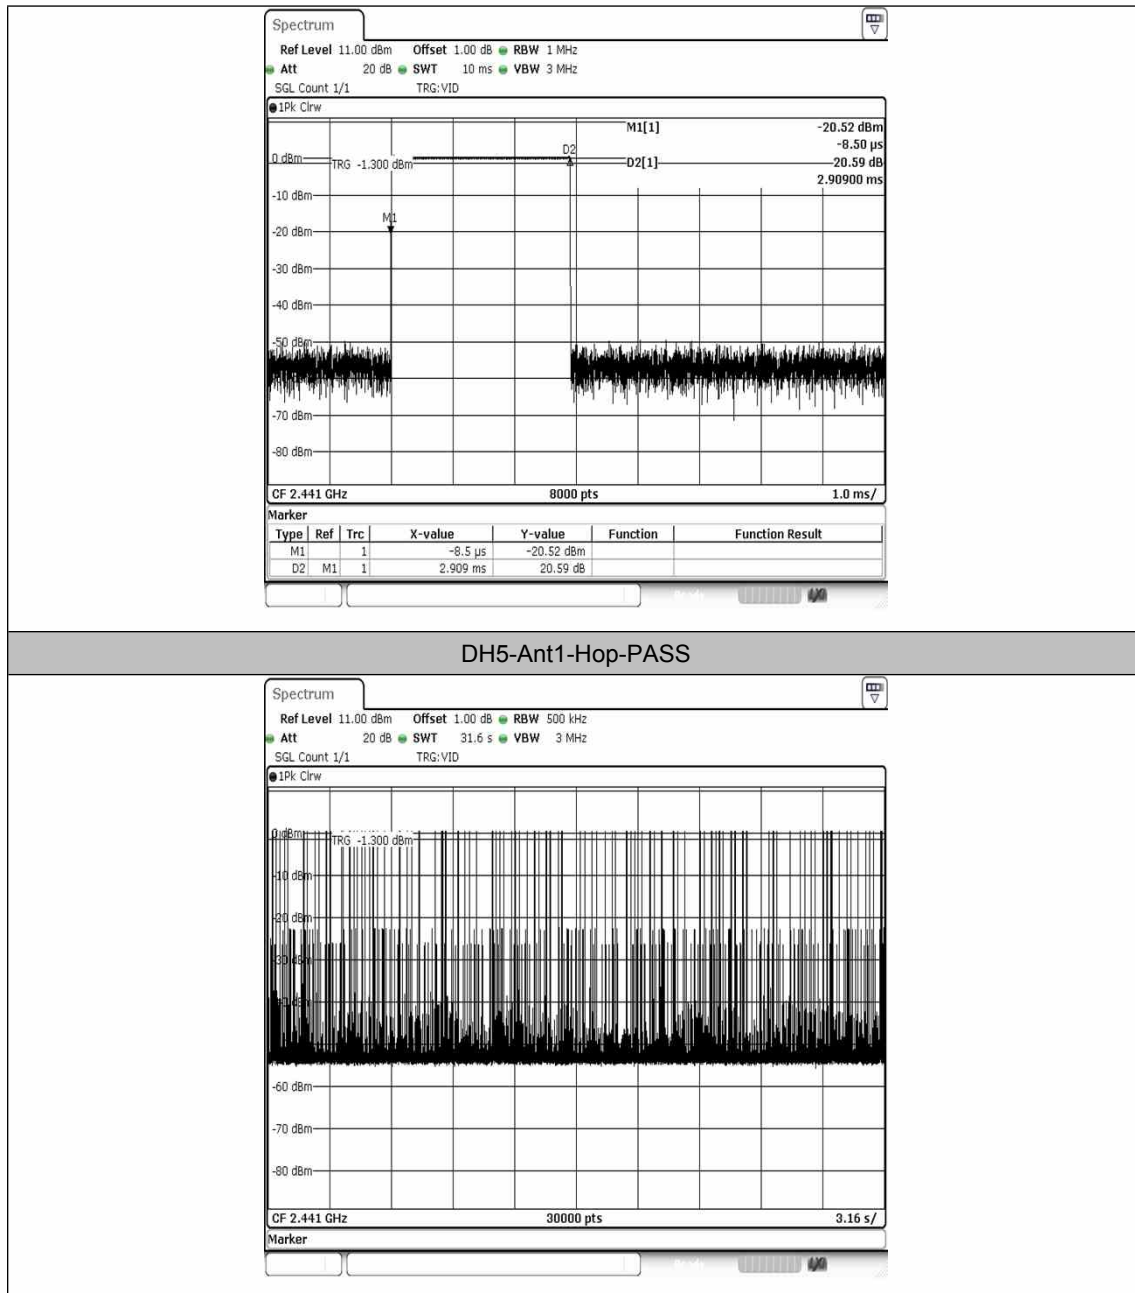

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

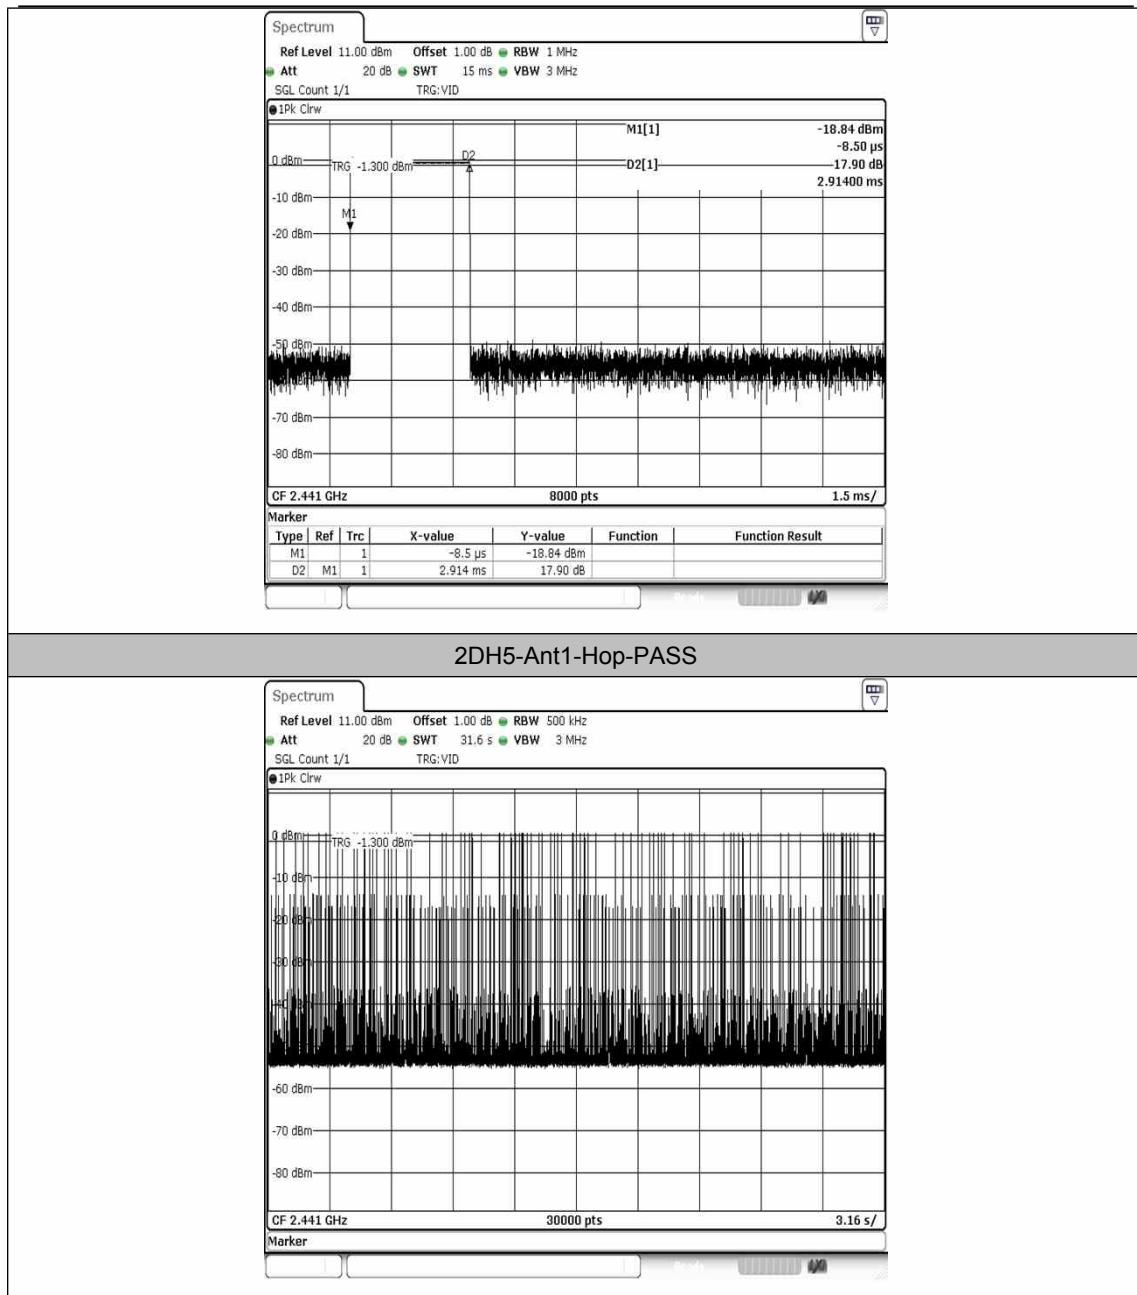

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

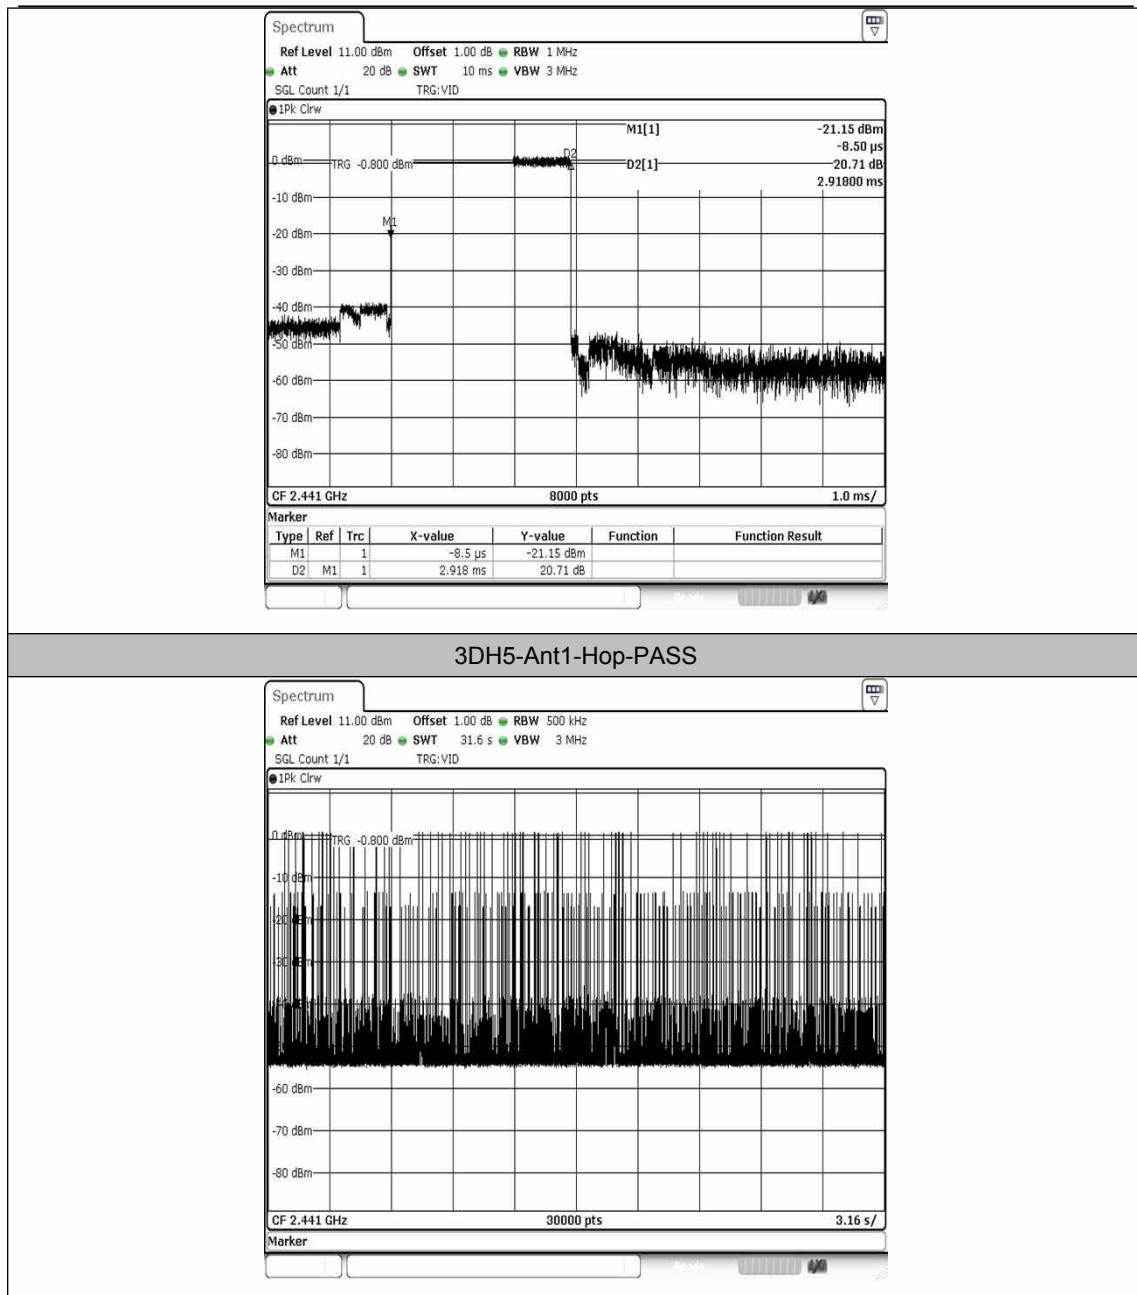

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix F: Number of Hopping Channel

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [Num]	Limit [Num]	Verdict
DH5	Ant1	Hop	79	≥15	PASS
2DH5	Ant1	Hop	79	≥15	PASS
3DH5	Ant1	Hop	79	≥15	PASS

Test Graphs

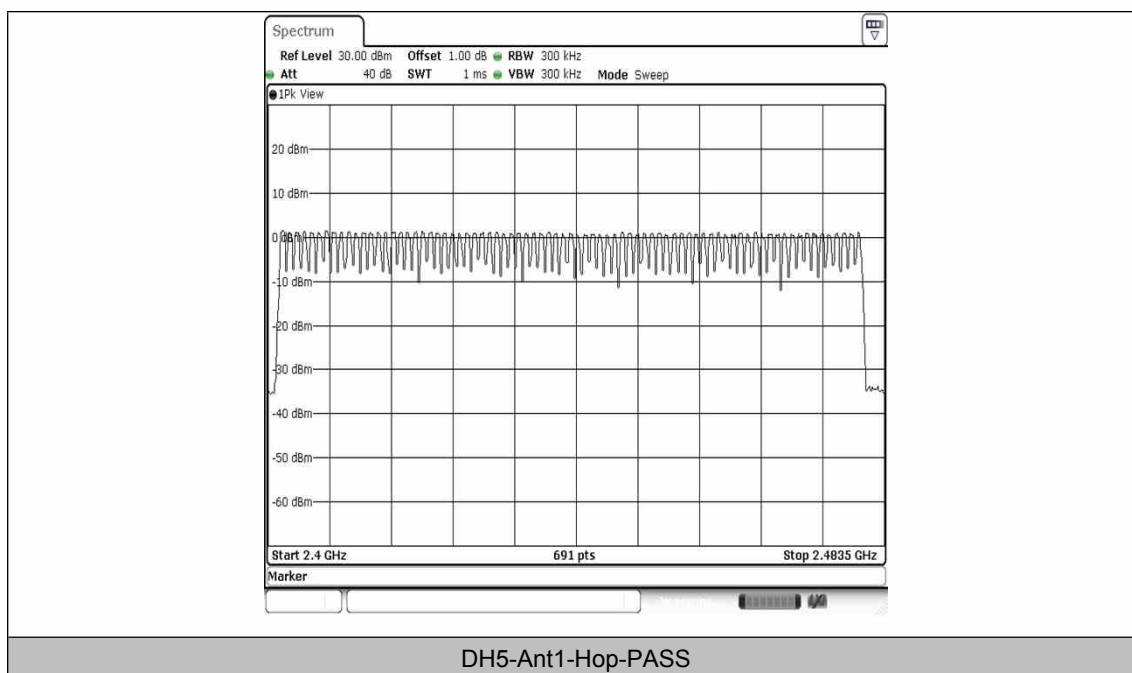

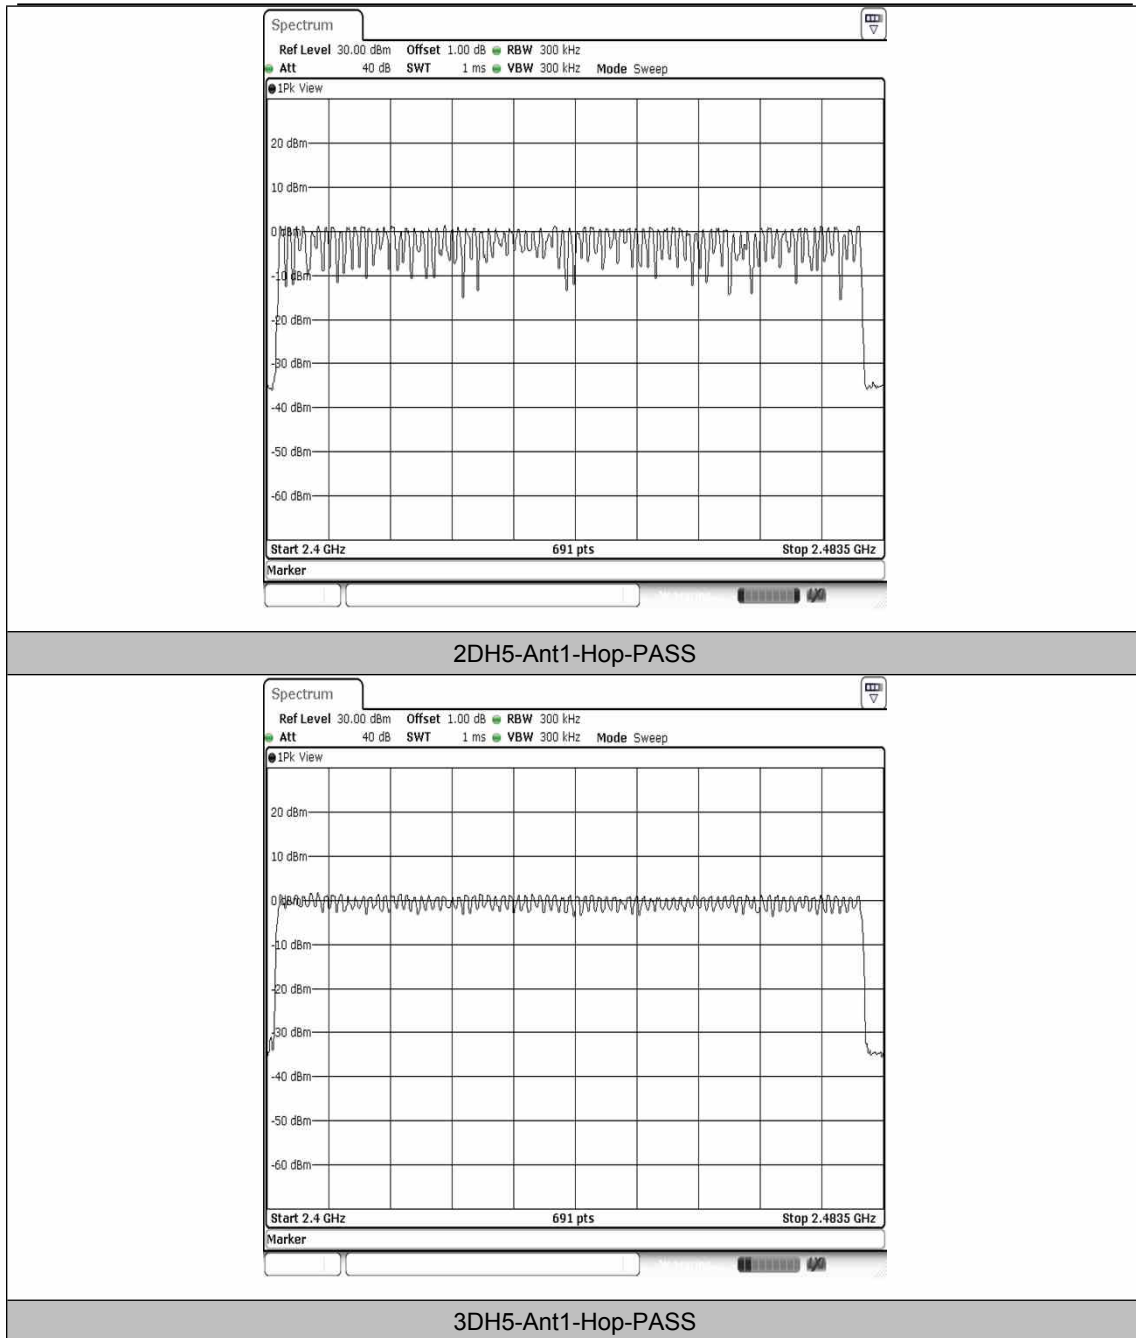

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix G: Conducted Band edge

Test Result

Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	1.01	-52.87	≤-18.99	PASS
DH5	Ant1	High	2480	0.50	-55.83	≤-19.5	PASS
DH5	Ant1	Low	Hop_2402	1.03	-53.52	≤-18.97	PASS
DH5	Ant1	High	Hop_2480	0.42	-56.36	≤-19.58	PASS
2DH5	Ant1	Low	2402	0.90	-49.95	≤-19.1	PASS
2DH5	Ant1	High	2480	0.34	-53.48	≤-19.66	PASS
2DH5	Ant1	Low	Hop_2402	-0.05	-56.21	≤-20.05	PASS
2DH5	Ant1	High	Hop_2480	0.24	-56.11	≤-19.76	PASS
3DH5	Ant1	Low	2402	0.09	-45.26	≤-19.91	PASS
3DH5	Ant1	High	2480	0.25	-56.43	≤-19.75	PASS
3DH5	Ant1	Low	Hop_2402	-0.23	-52.11	≤-20.23	PASS
3DH5	Ant1	High	Hop_2480	0.21	-56.09	≤-19.79	PASS

Test Graphs

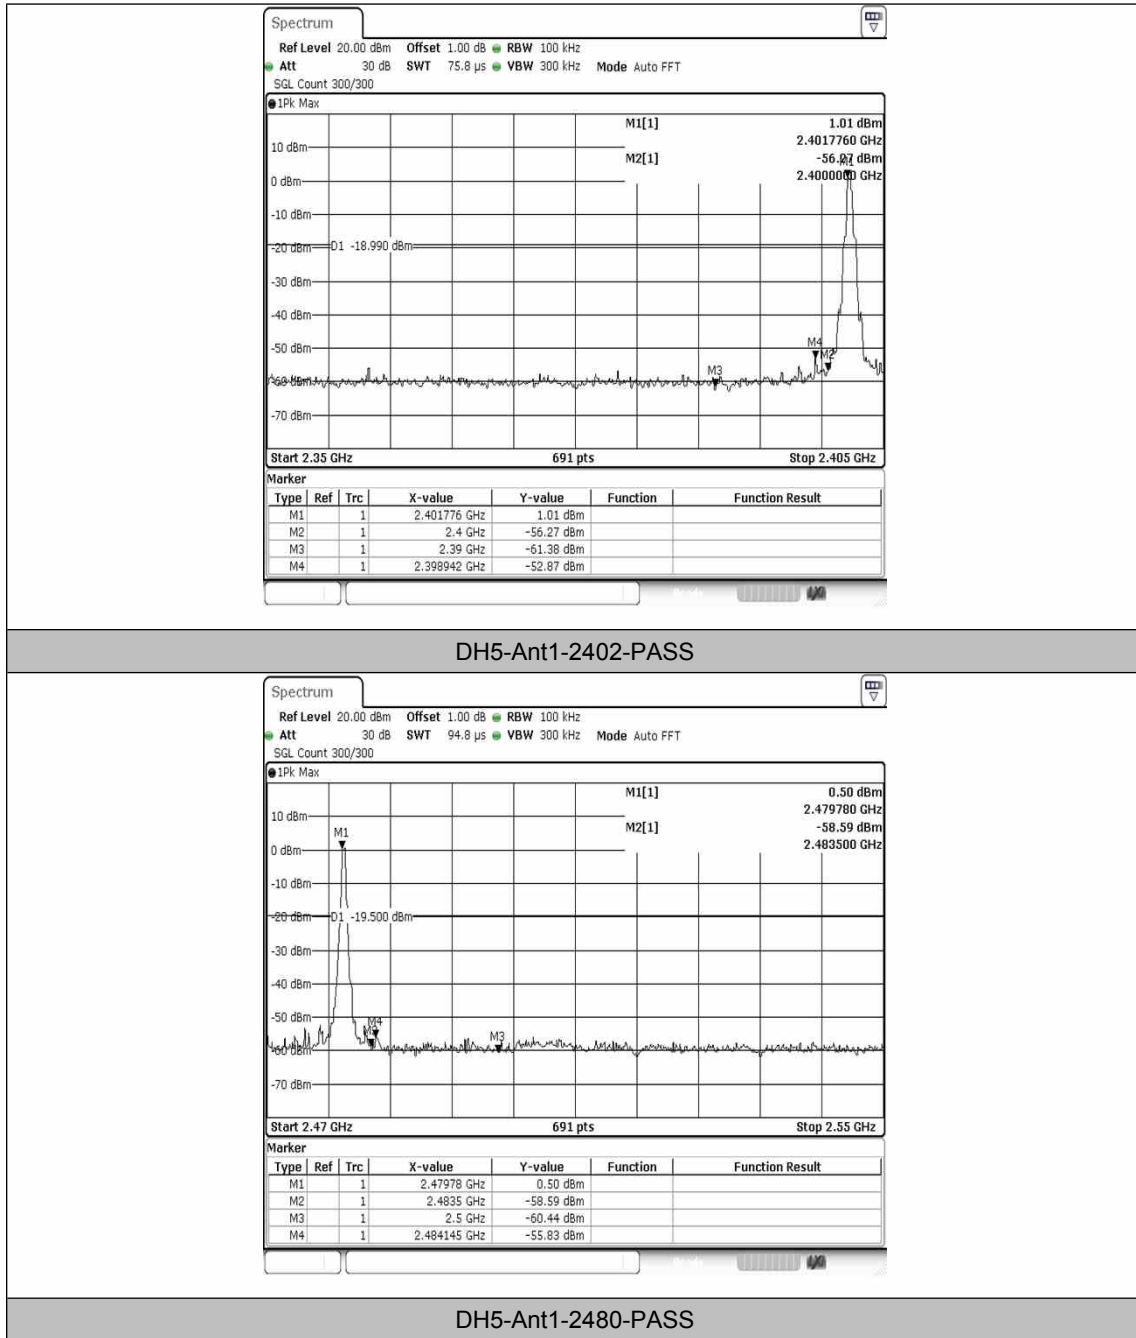


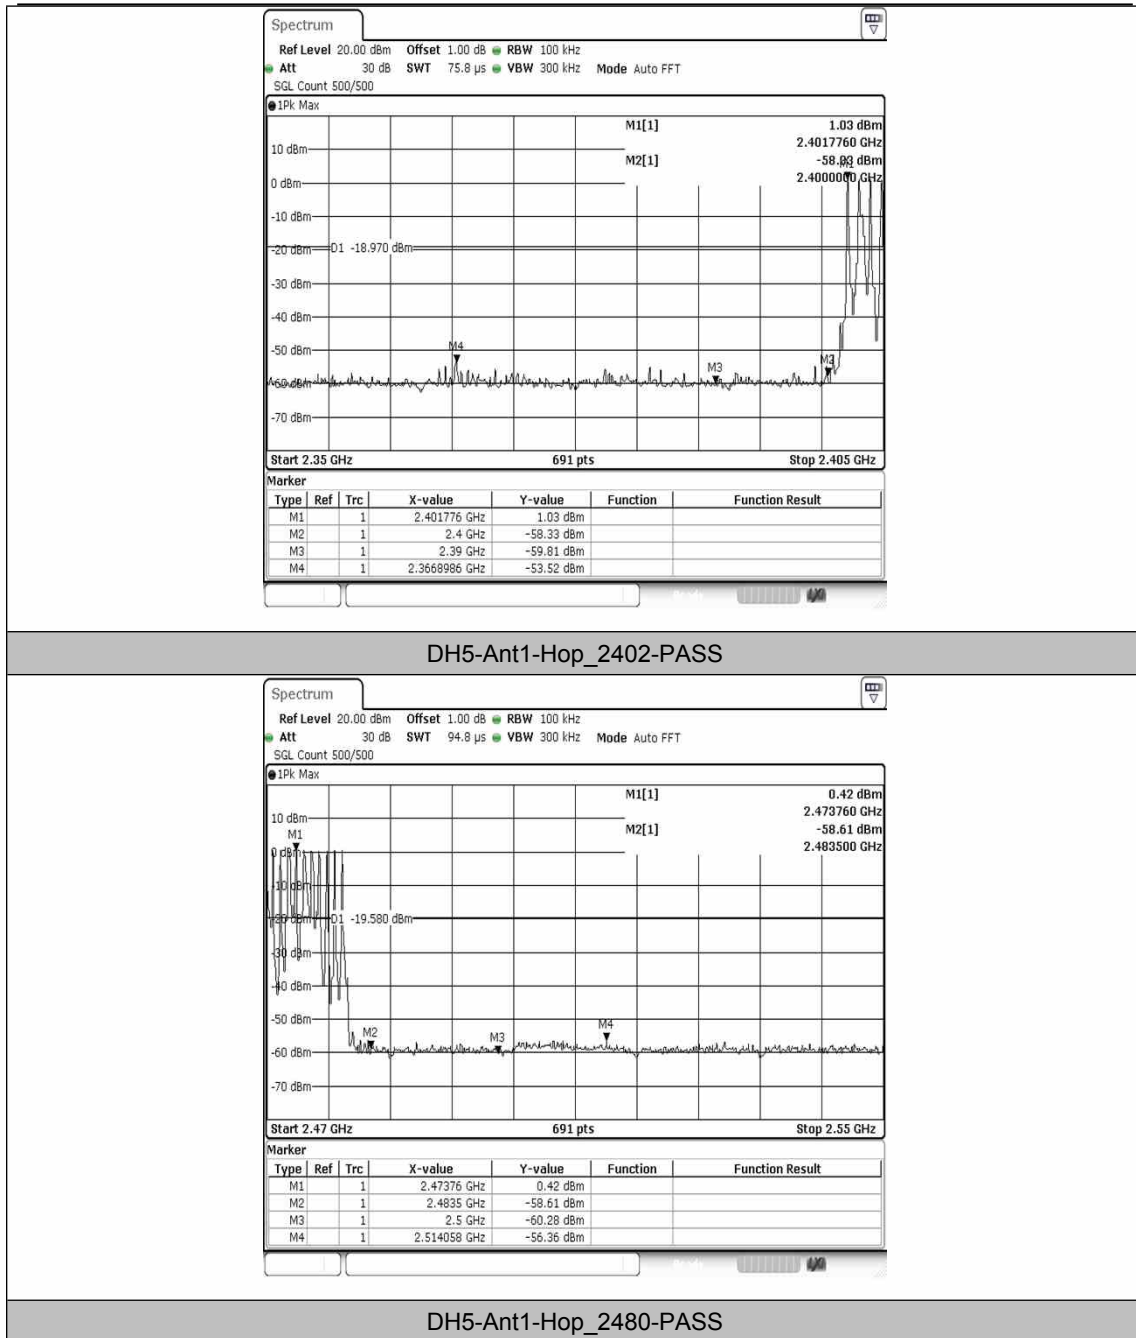

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

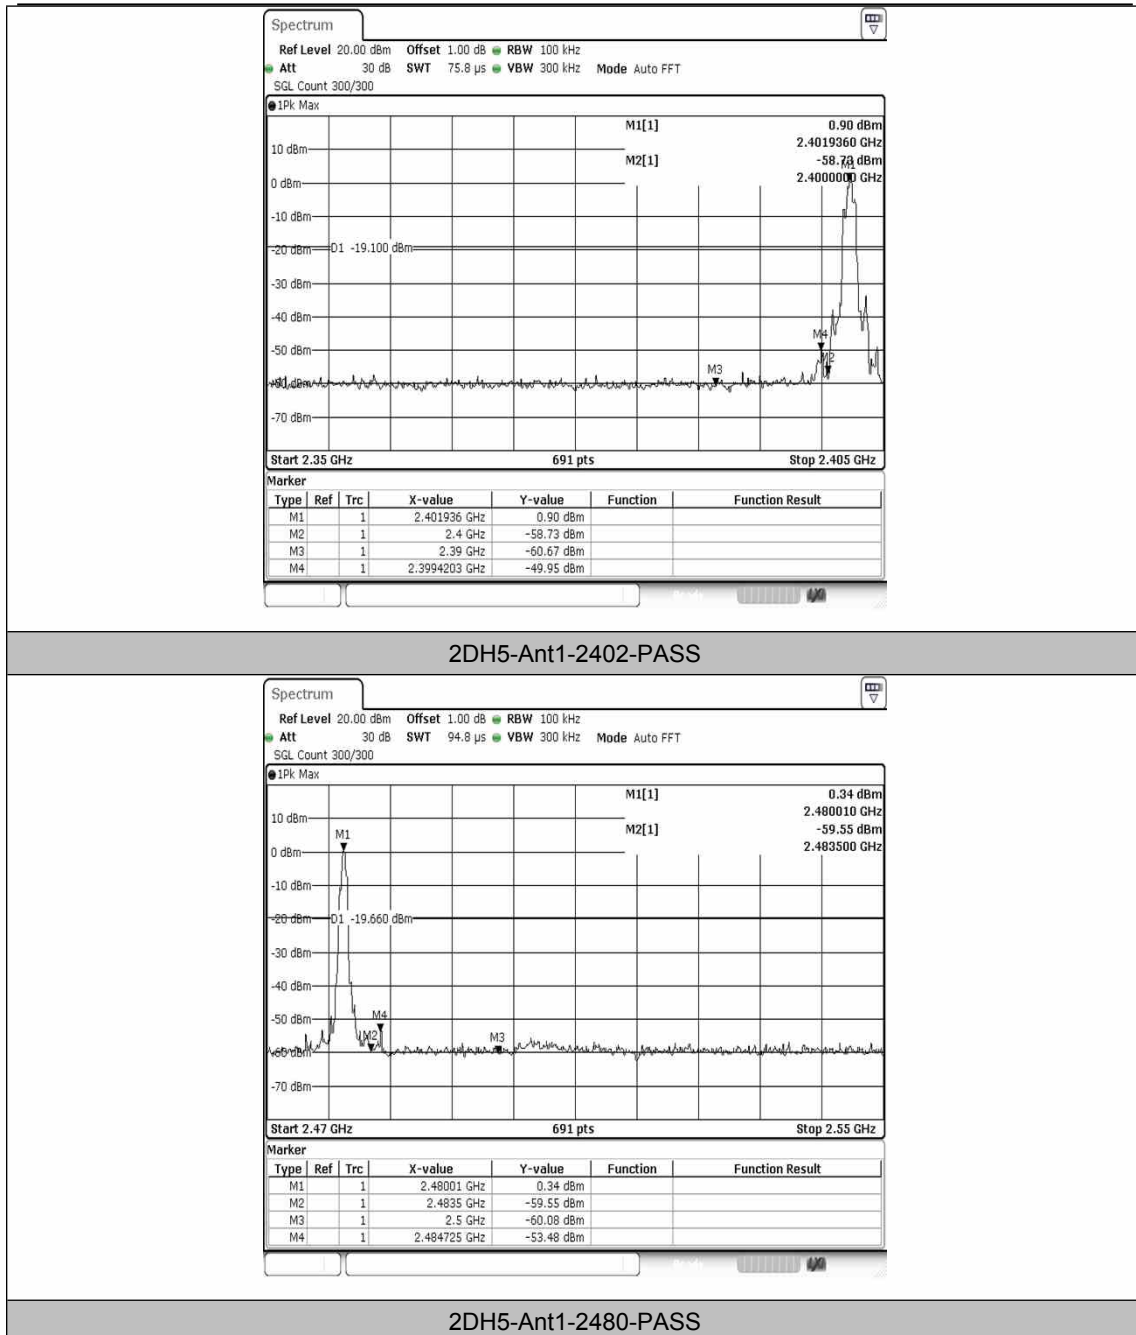



Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

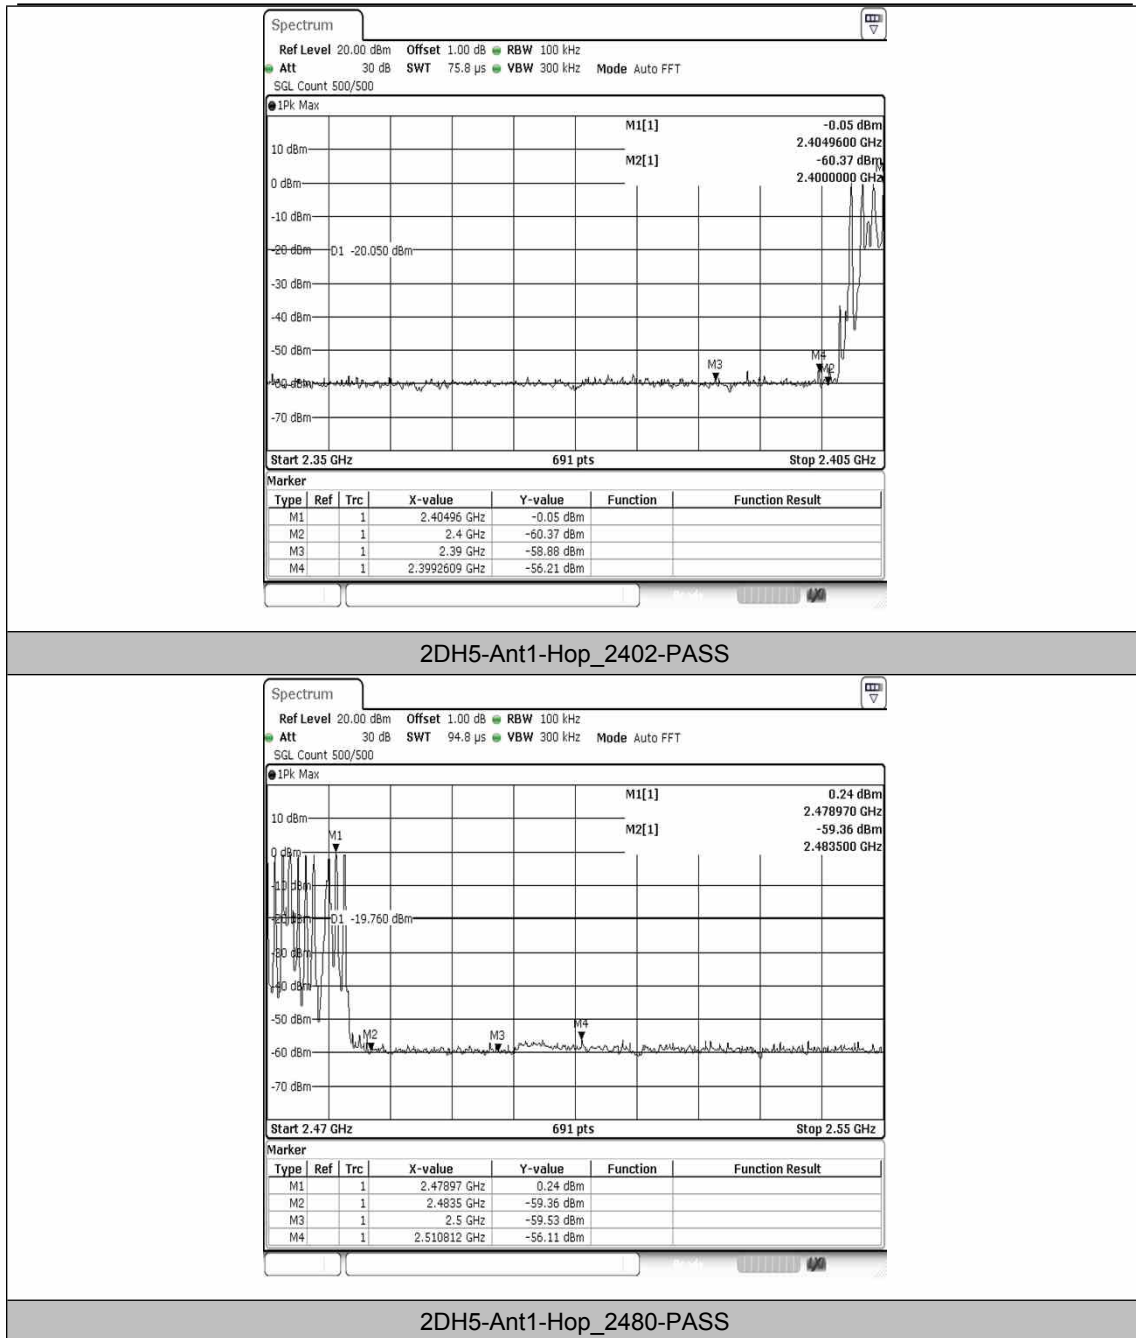

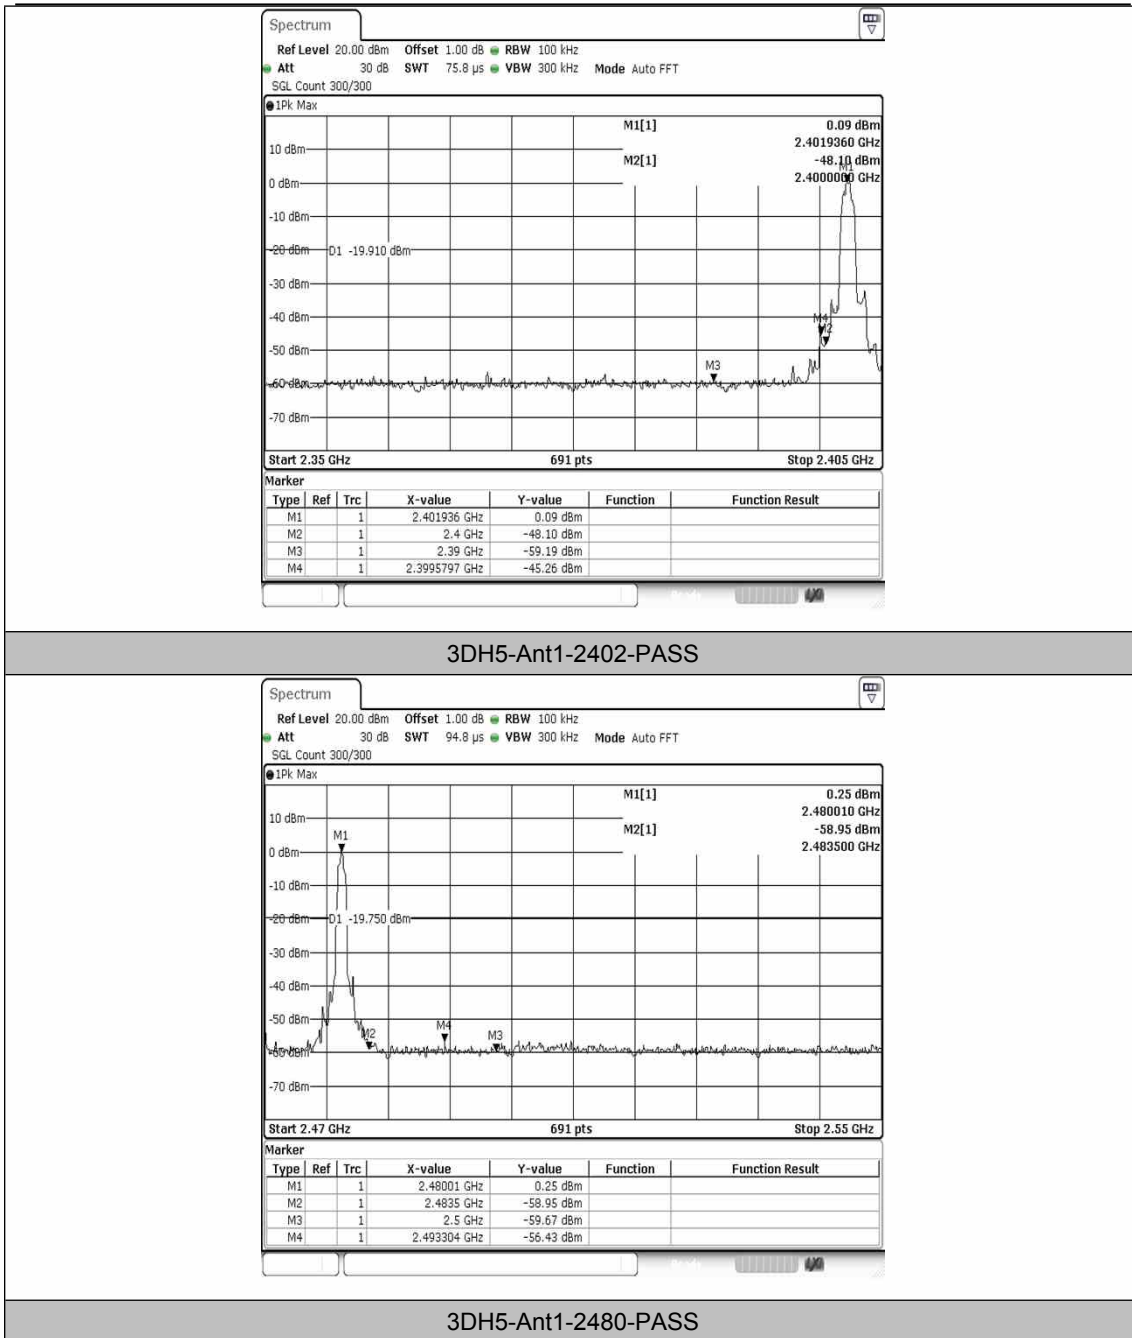

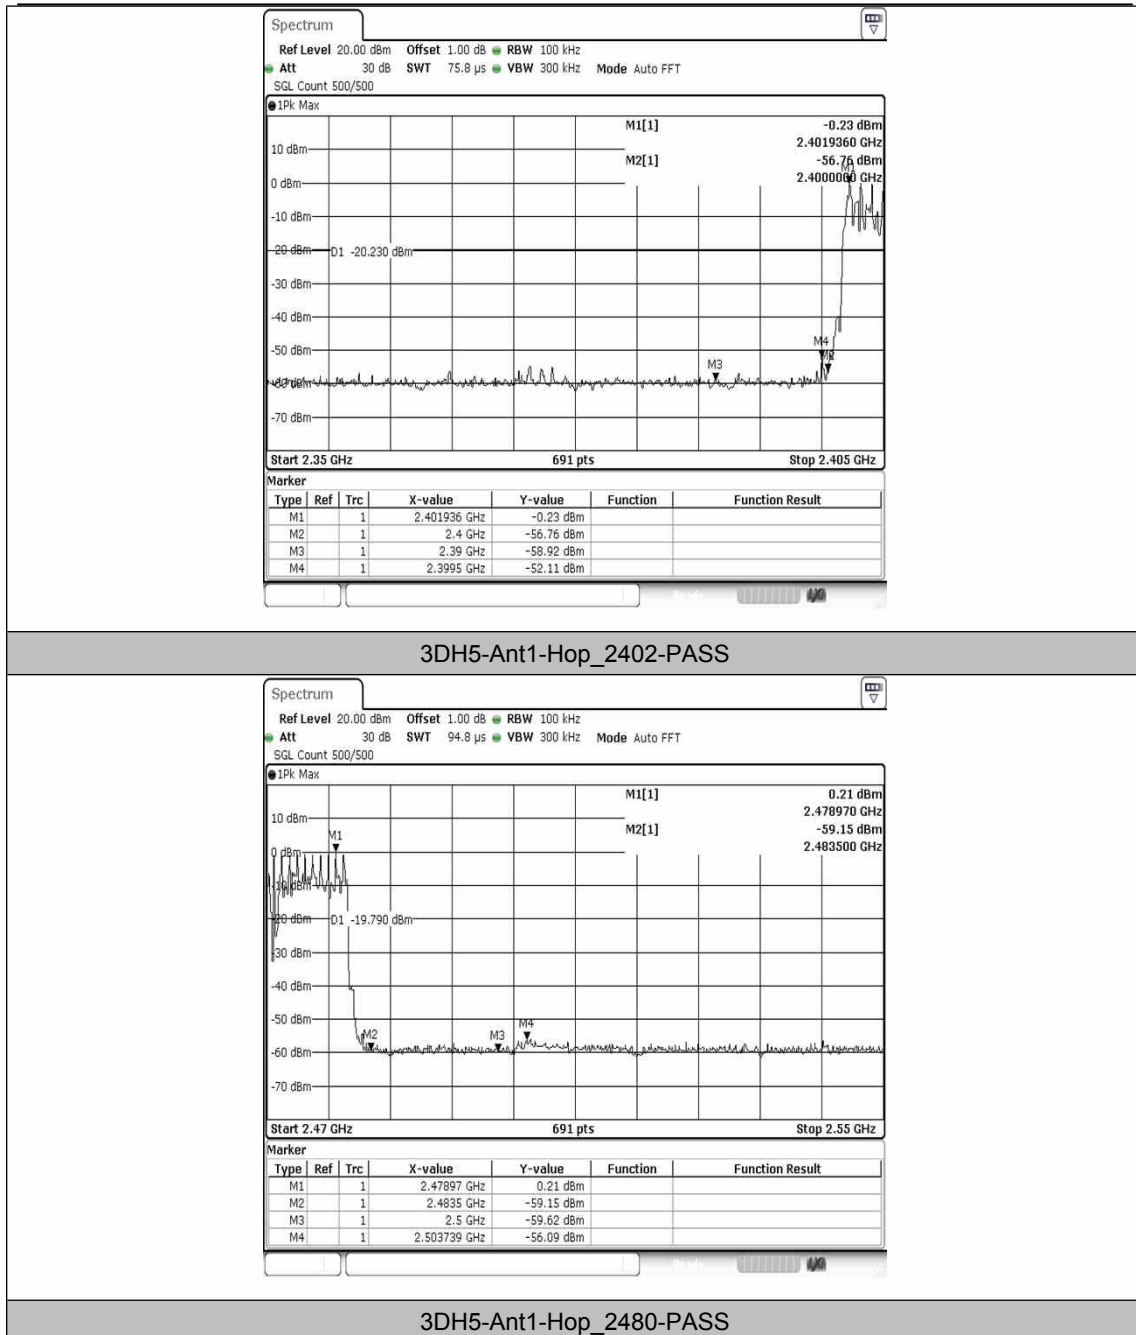


Appendix H: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	0.87	0.87	---	PASS
DH5	Ant1	2402	30~1000	0.87	-57.38	≤-19.13	PASS
DH5	Ant1	2402	1000~26500	0.87	-37.81	≤-19.13	PASS
DH5	Ant1	2441	0~Reference	0.58	0.58	---	PASS
DH5	Ant1	2441	30~1000	0.58	-58.26	≤-19.42	PASS
DH5	Ant1	2441	1000~26500	0.58	-39.51	≤-19.42	PASS
DH5	Ant1	2480	0~Reference	0.40	0.40	---	PASS
DH5	Ant1	2480	30~1000	0.40	-58.18	≤-19.6	PASS
DH5	Ant1	2480	1000~26500	0.40	-43.84	≤-19.6	PASS
2DH5	Ant1	2402	0~Reference	-0.07	-0.07	---	PASS
2DH5	Ant1	2402	30~1000	-0.07	-58.49	≤-20.07	PASS
2DH5	Ant1	2402	1000~26500	-0.07	-41.67	≤-20.07	PASS
2DH5	Ant1	2441	0~Reference	-0.55	-0.55	---	PASS
2DH5	Ant1	2441	30~1000	-0.55	-58.34	≤-20.55	PASS
2DH5	Ant1	2441	1000~26500	-0.55	-40.07	≤-20.55	PASS
2DH5	Ant1	2480	0~Reference	0.23	0.23	---	PASS
2DH5	Ant1	2480	30~1000	0.23	-58.38	≤-19.77	PASS
2DH5	Ant1	2480	1000~26500	0.23	-42.98	≤-19.77	PASS
3DH5	Ant1	2402	0~Reference	-0.23	-0.23	---	PASS
3DH5	Ant1	2402	30~1000	-0.23	-57.64	≤-20.23	PASS
3DH5	Ant1	2402	1000~26500	-0.23	-40.78	≤-20.23	PASS
3DH5	Ant1	2441	0~Reference	-0.39	-0.39	---	PASS
3DH5	Ant1	2441	30~1000	-0.39	-58.16	≤-20.39	PASS
3DH5	Ant1	2441	1000~26500	-0.39	-40.61	≤-20.39	PASS
3DH5	Ant1	2480	0~Reference	-1.09	-1.09	---	PASS
3DH5	Ant1	2480	30~1000	-1.09	-58.2	≤-21.09	PASS
3DH5	Ant1	2480	1000~26500	-1.09	-43.33	≤-21.09	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'TDF' of the Spectrum Analyzer during the test.


Test Graphs

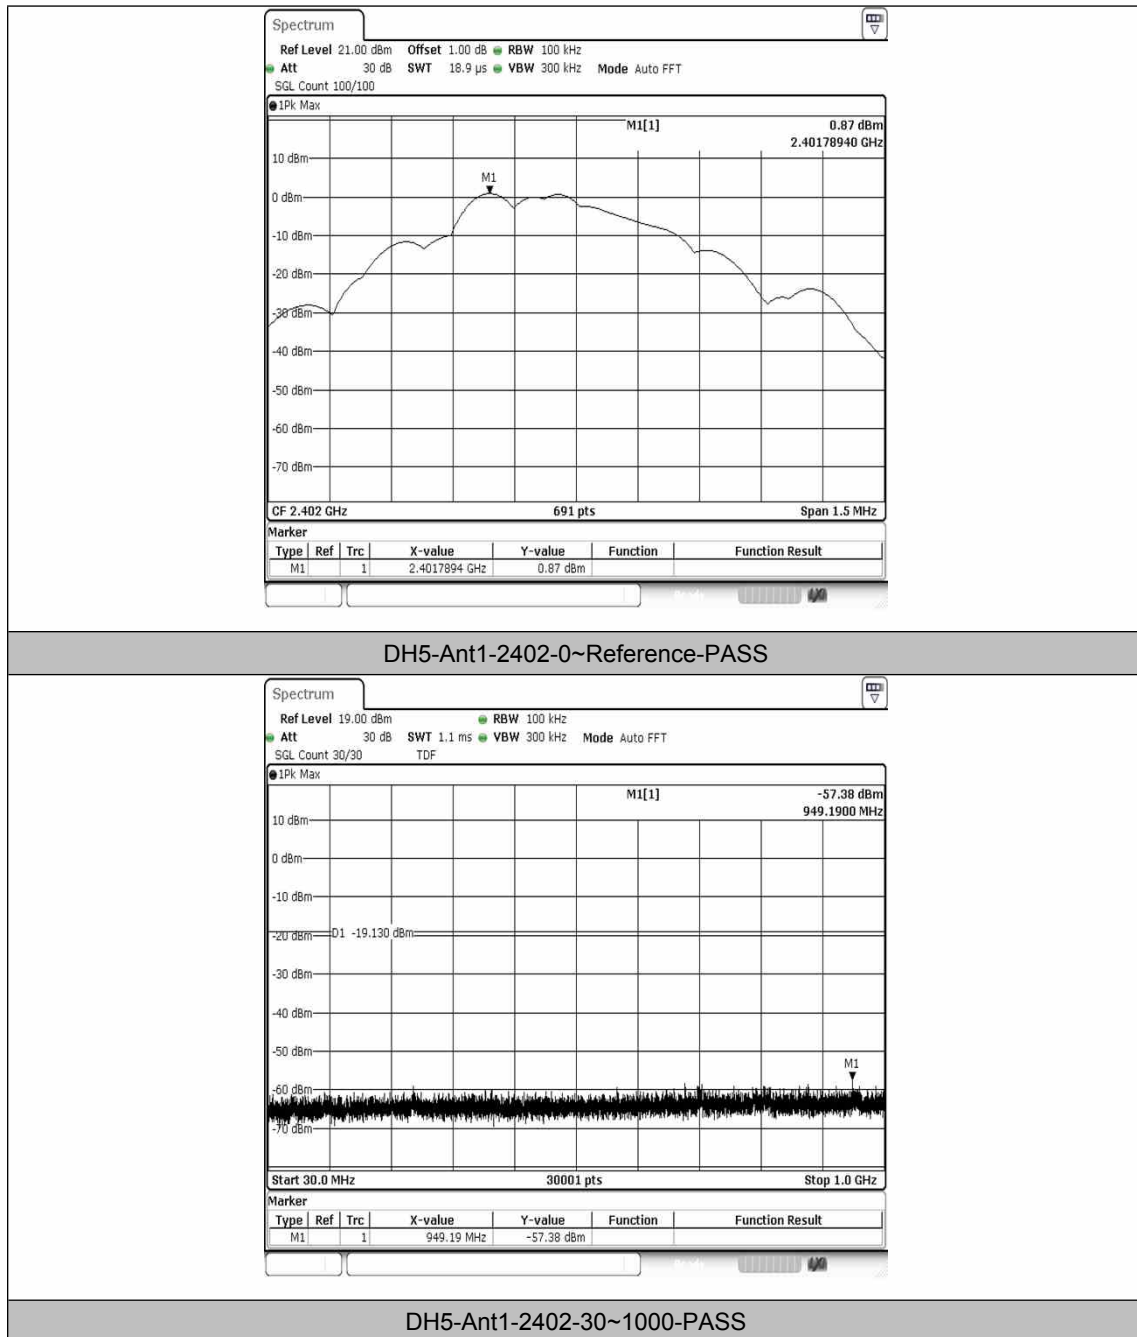

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

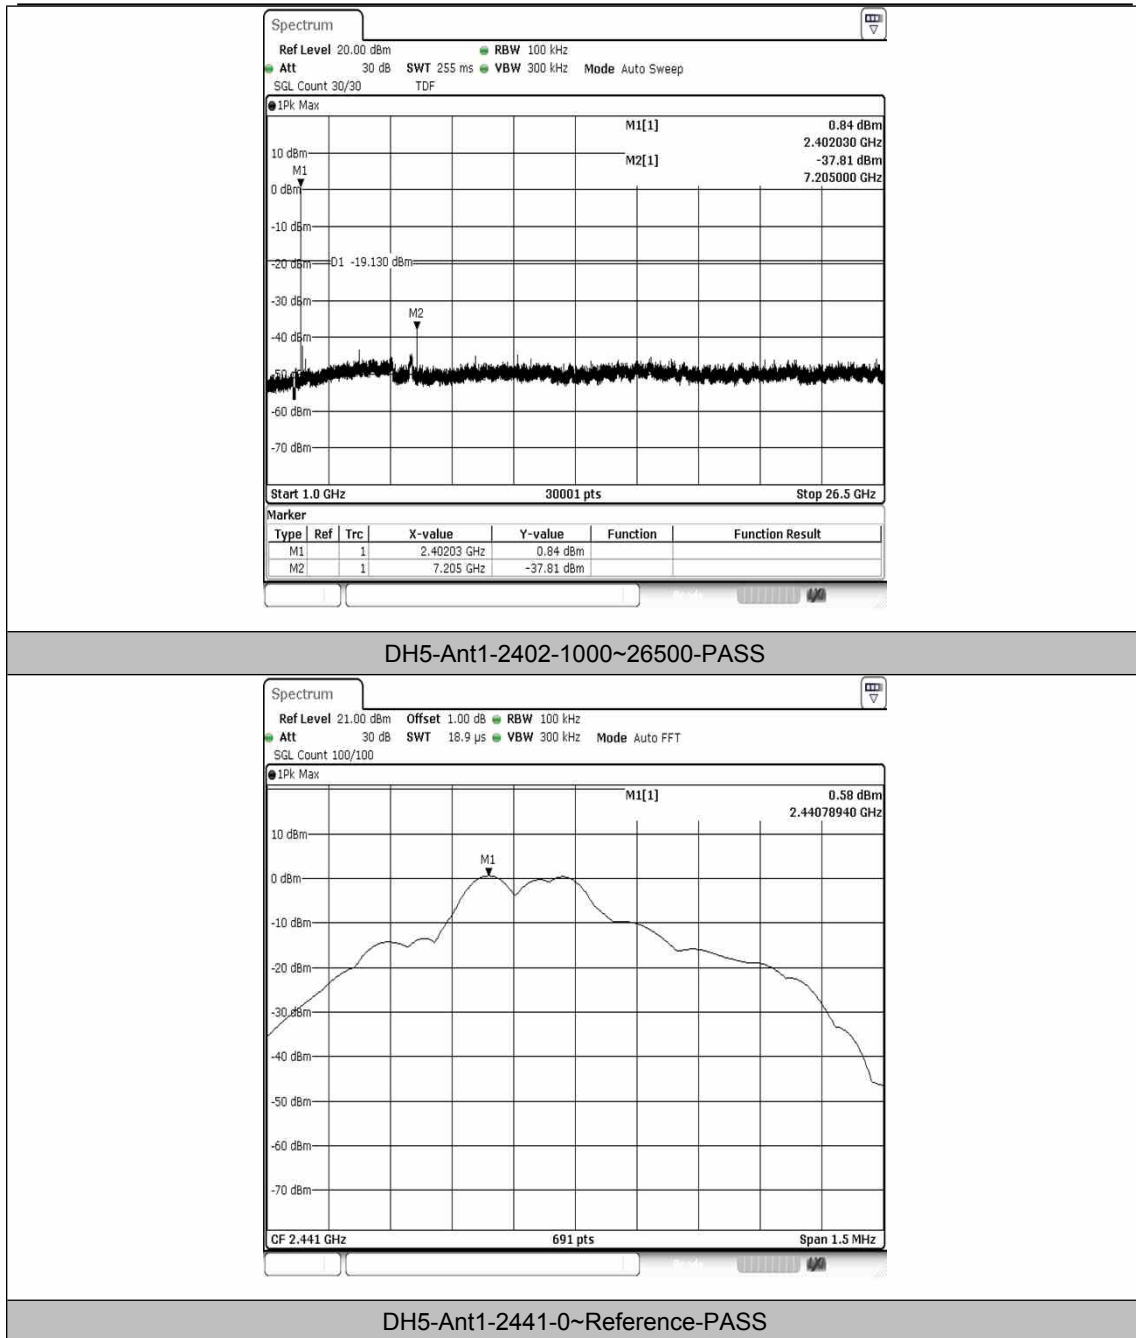

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

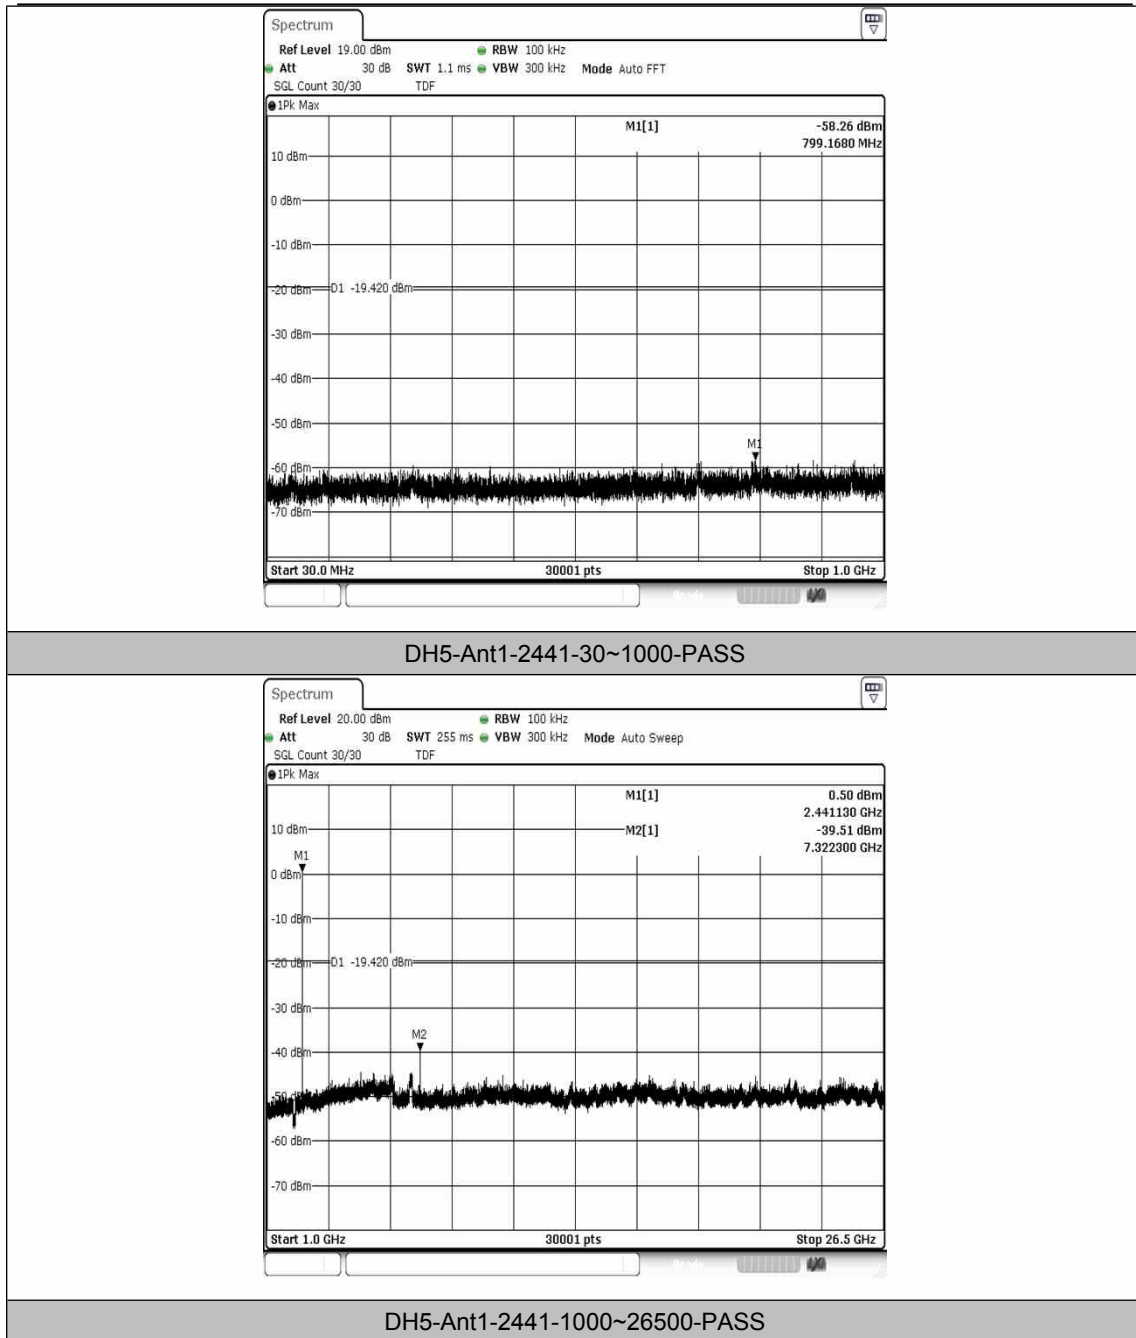

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

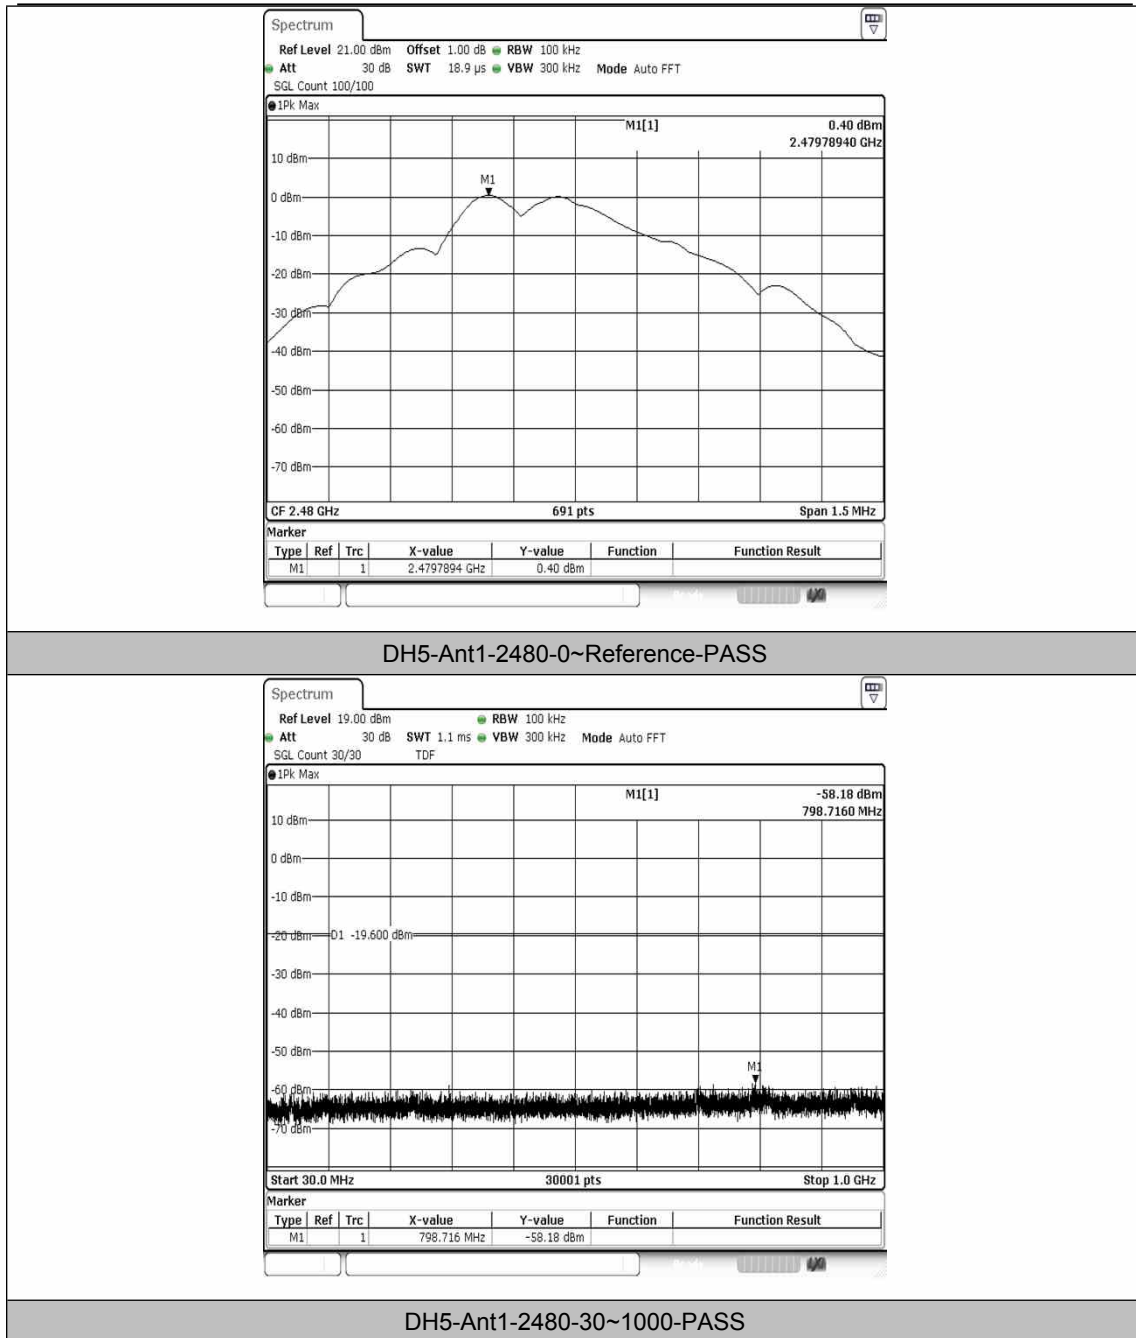


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

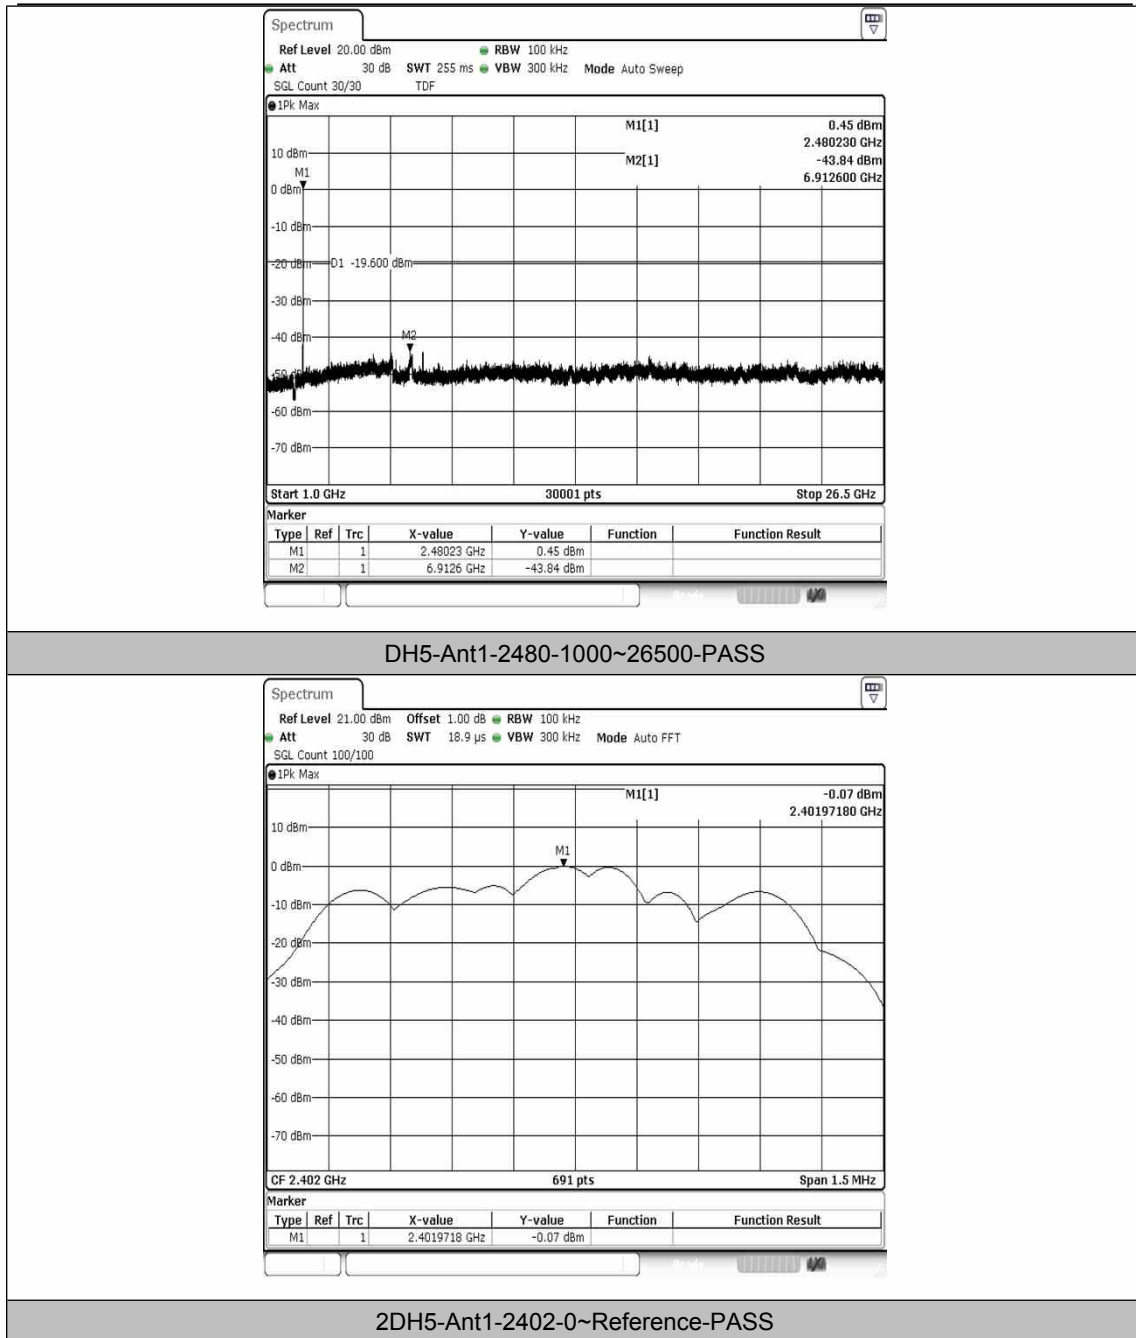


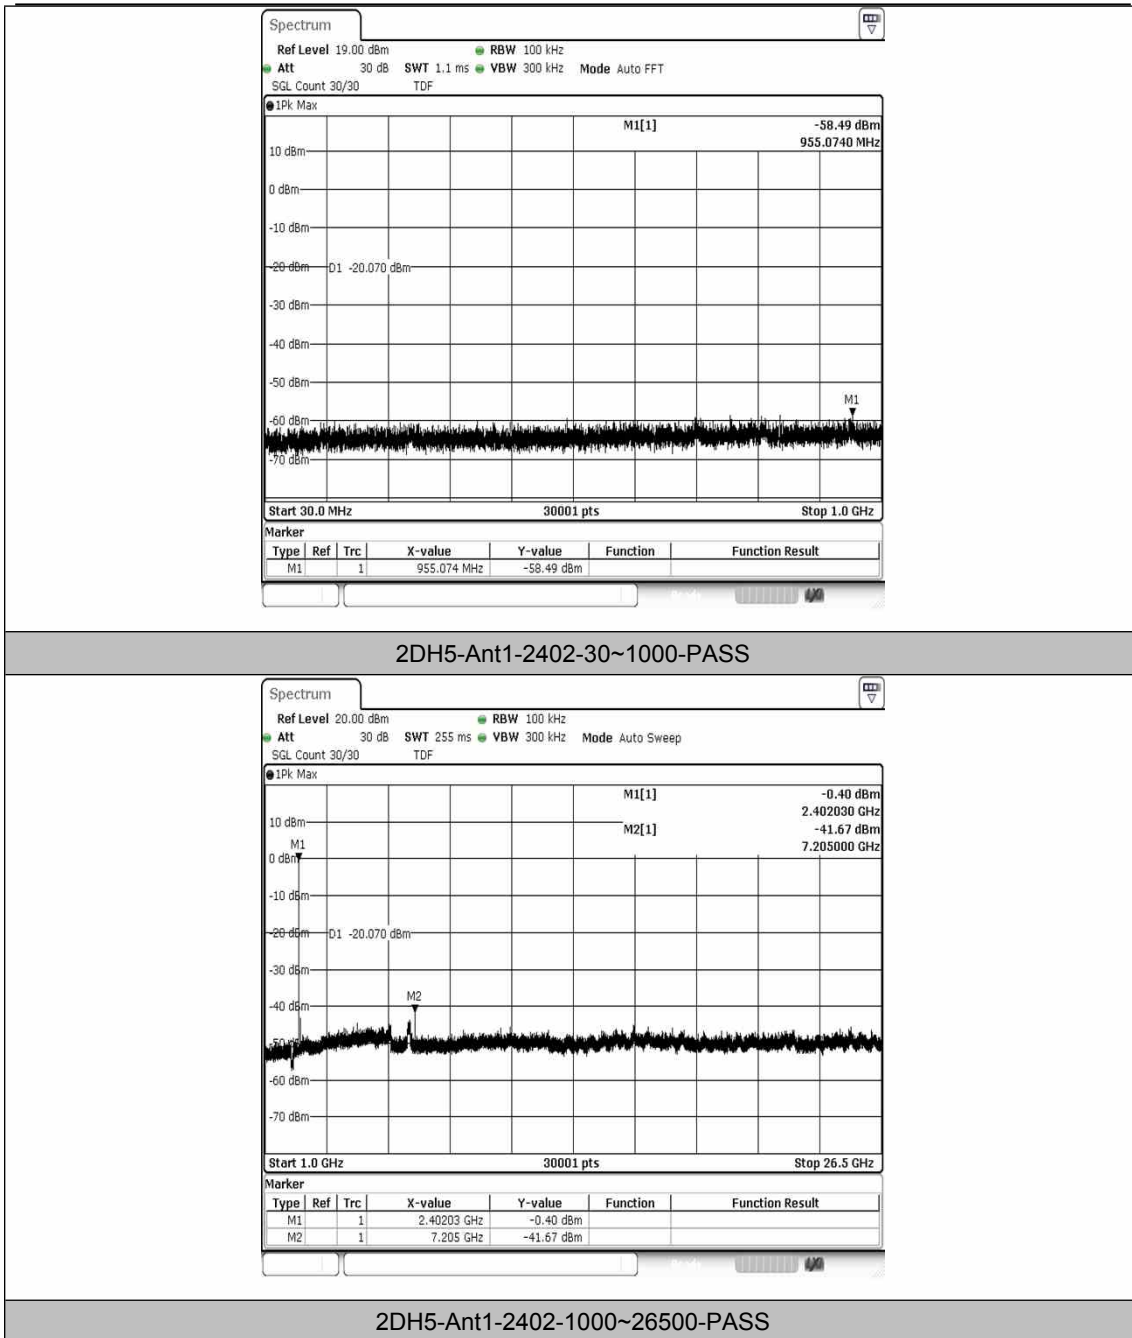


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

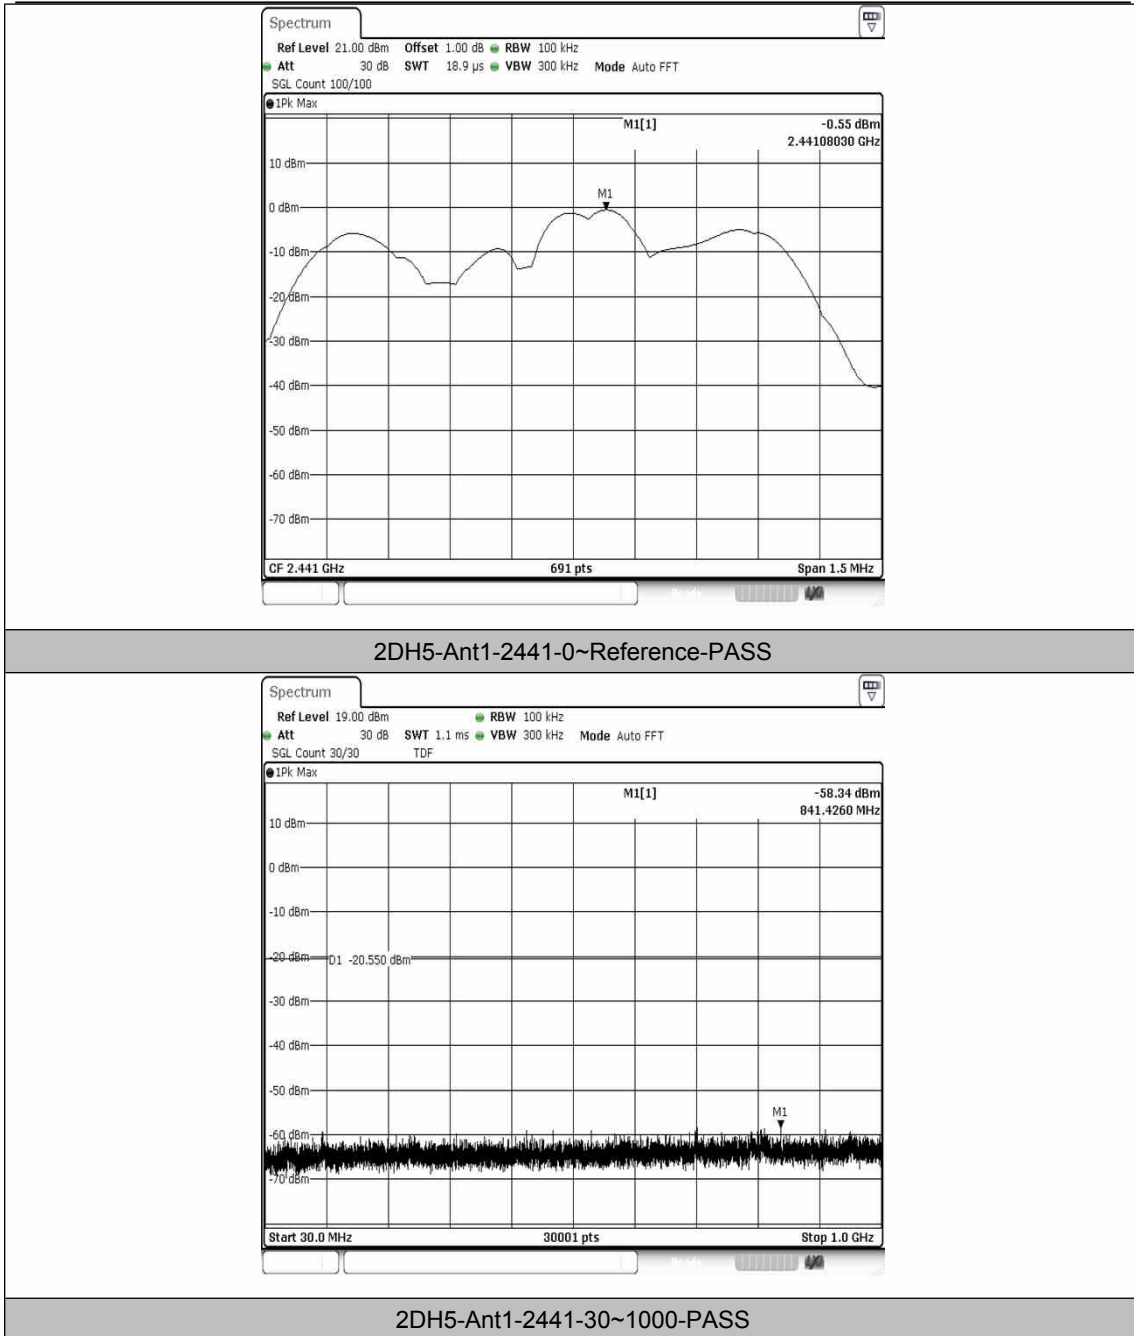


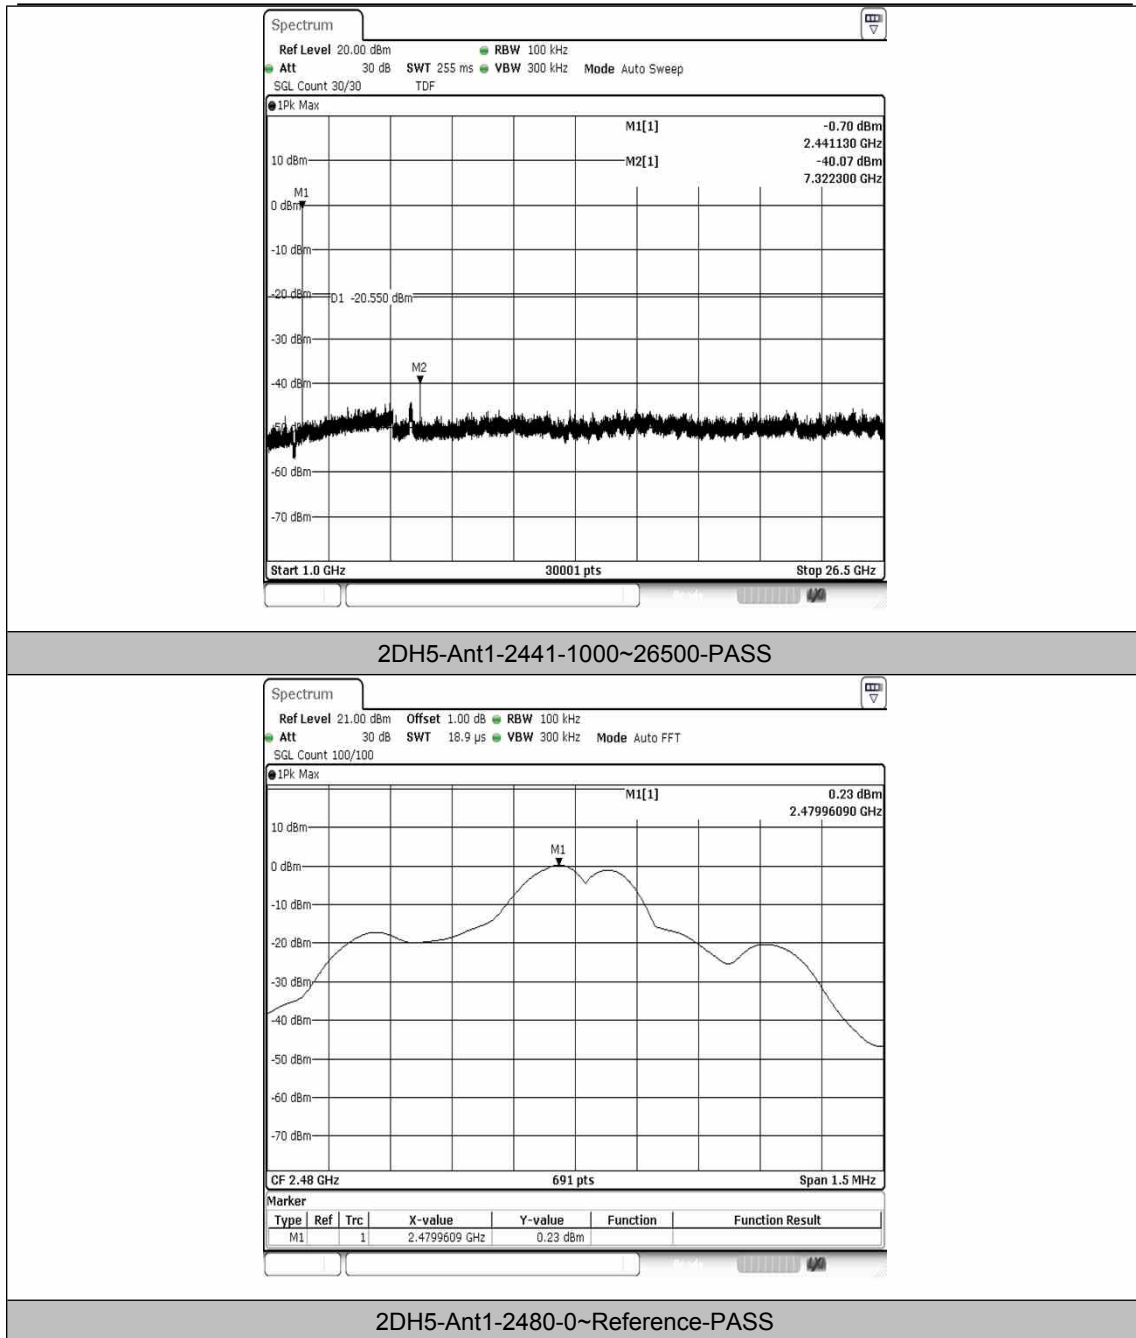

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

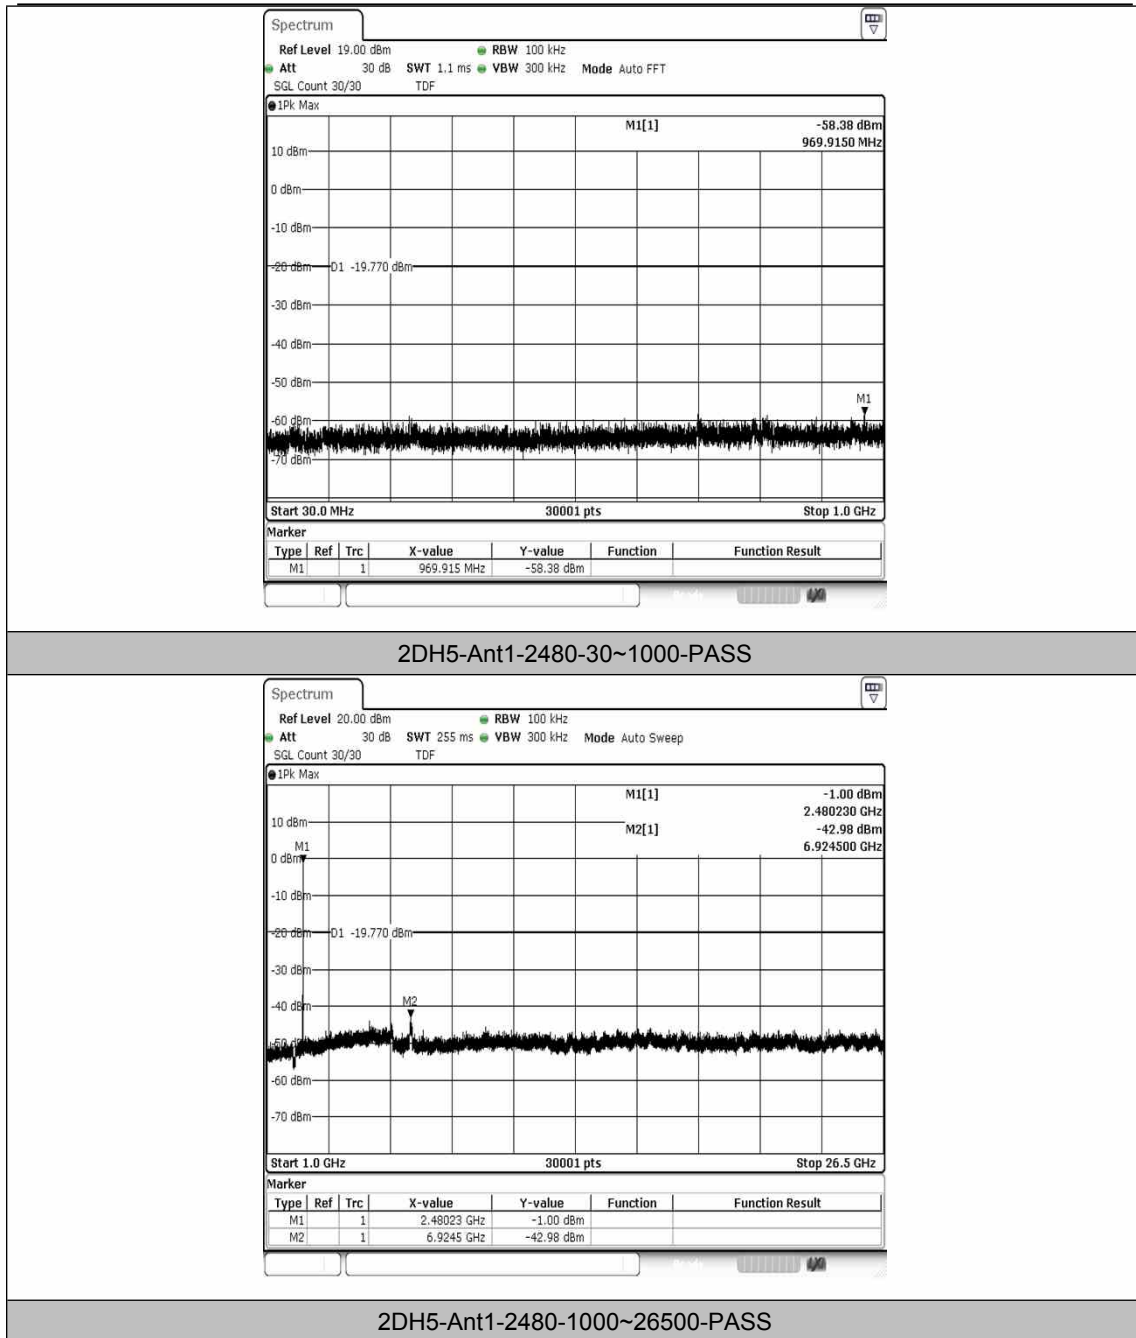

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

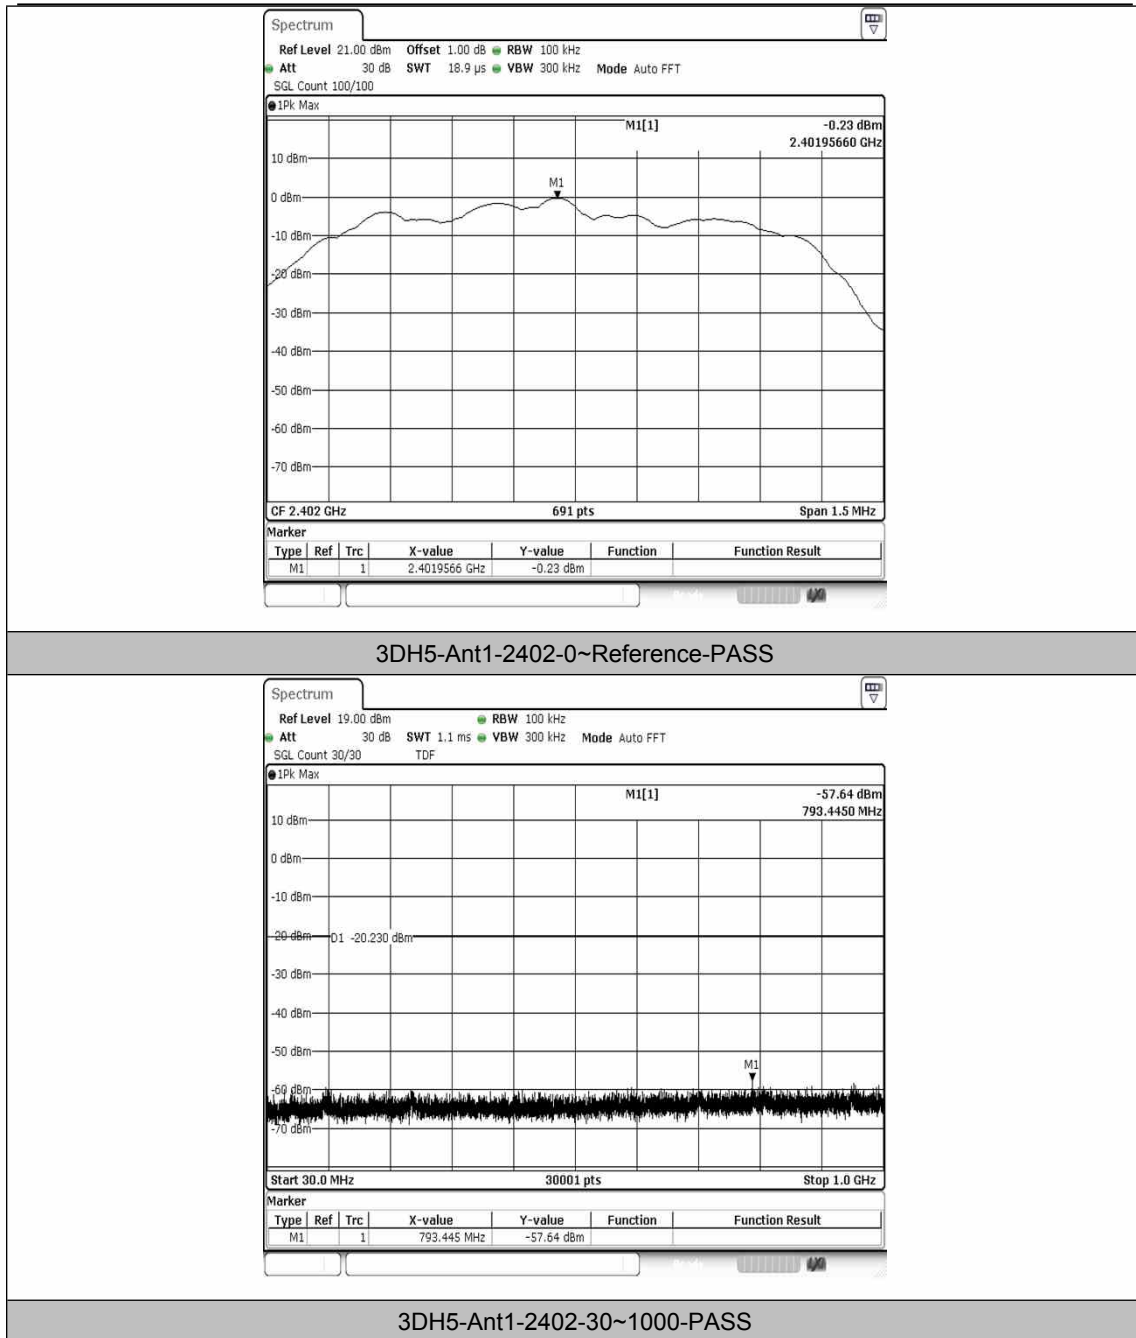

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

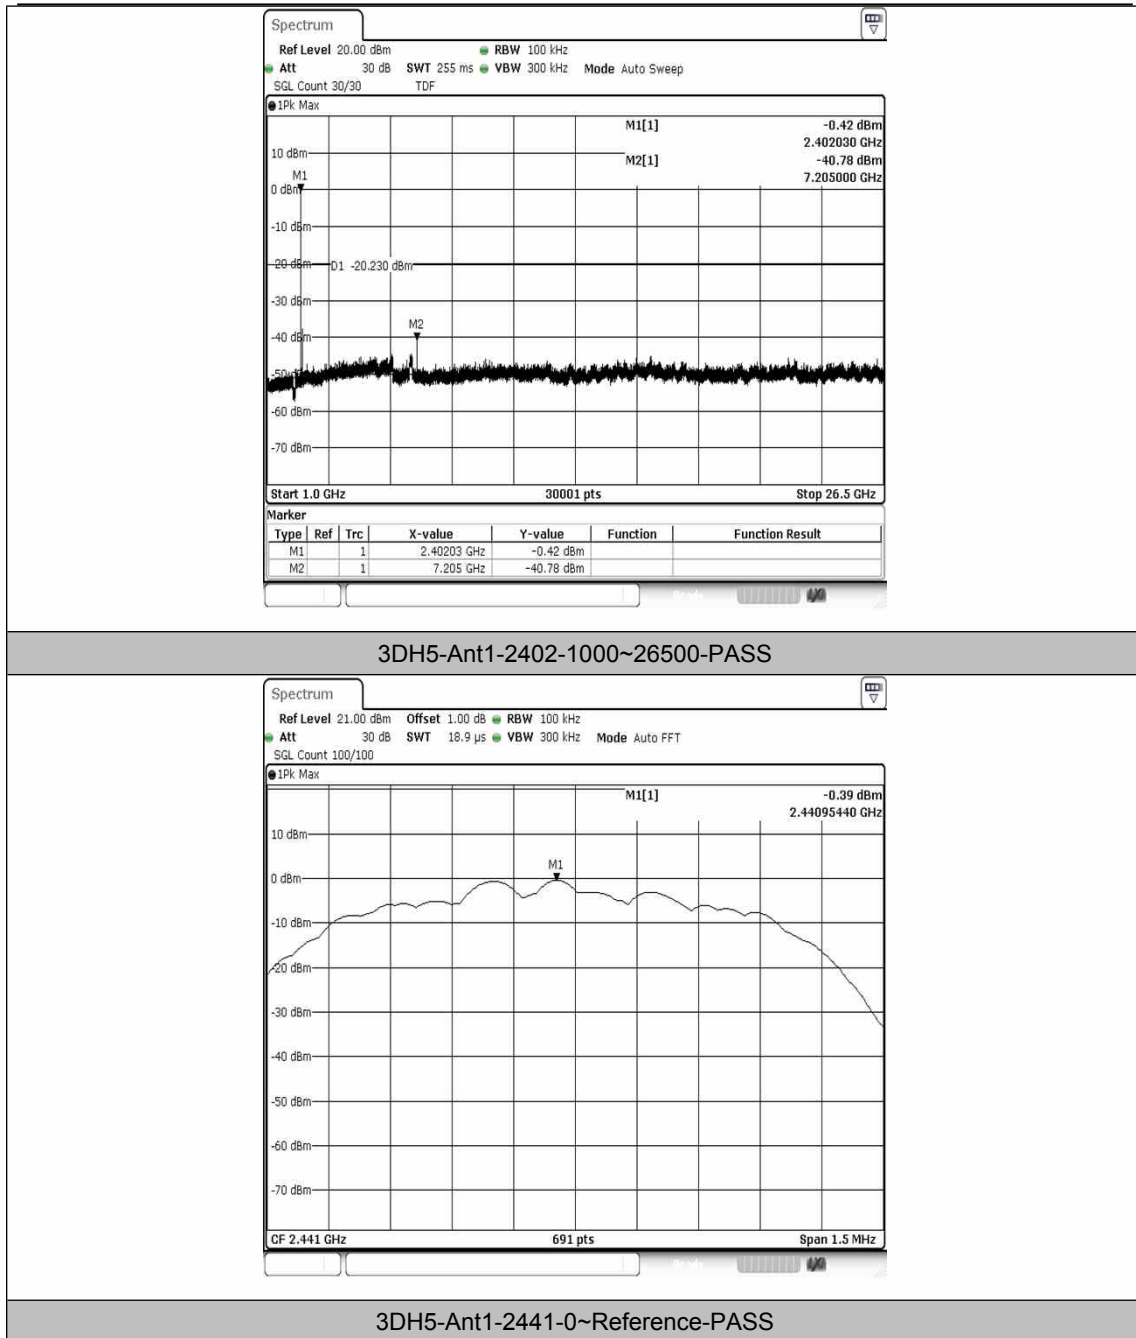

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

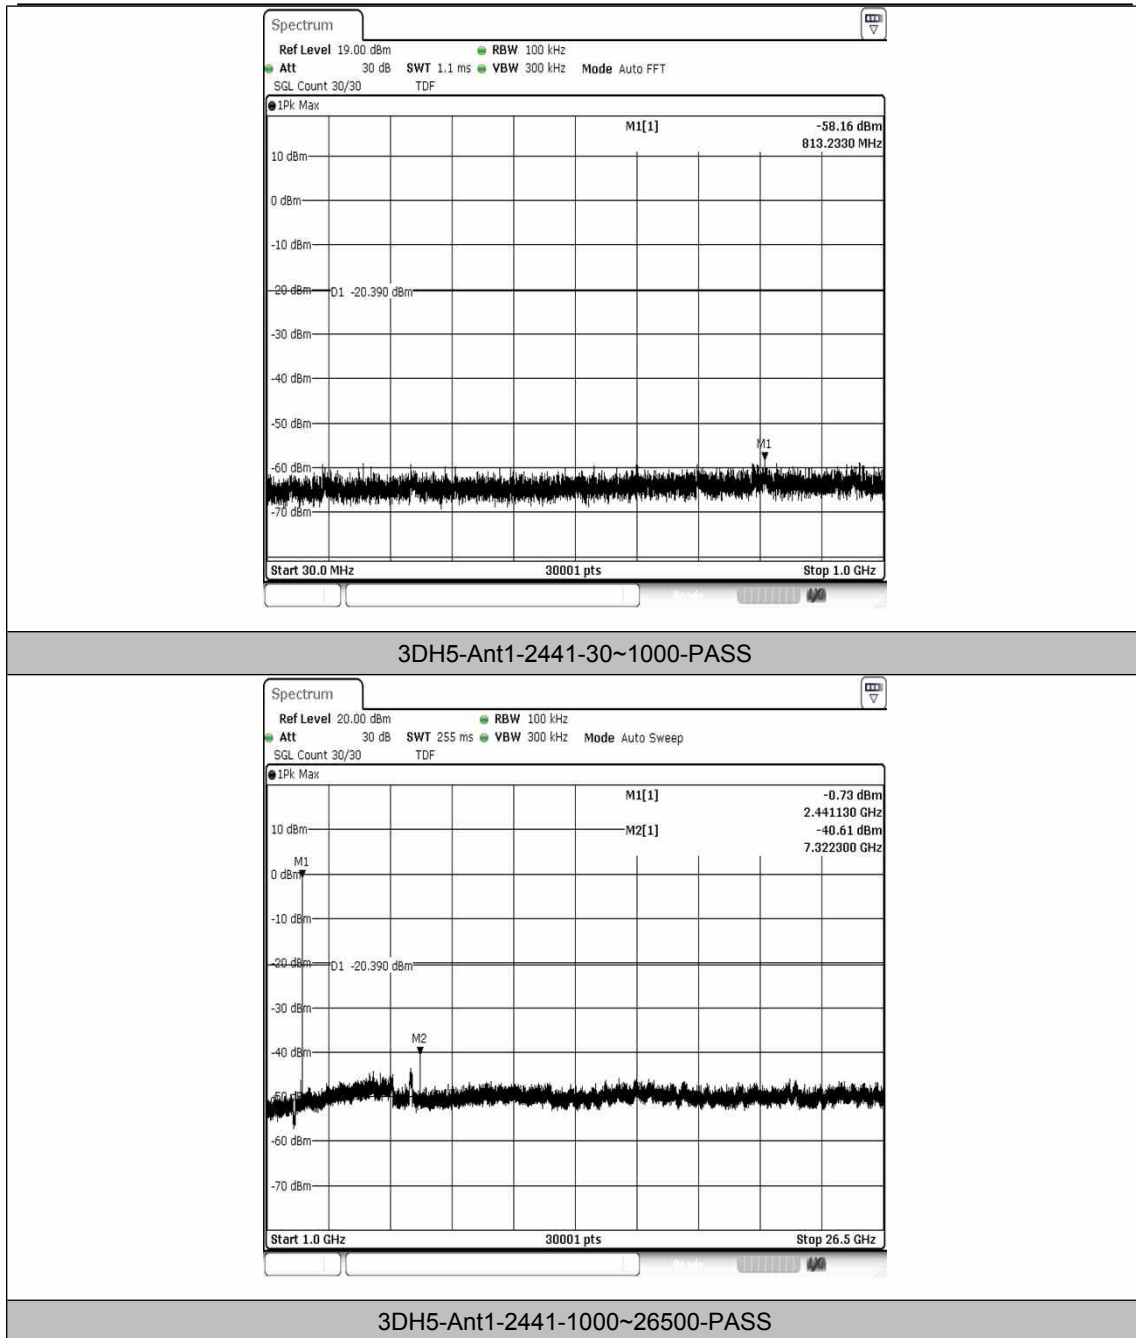

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

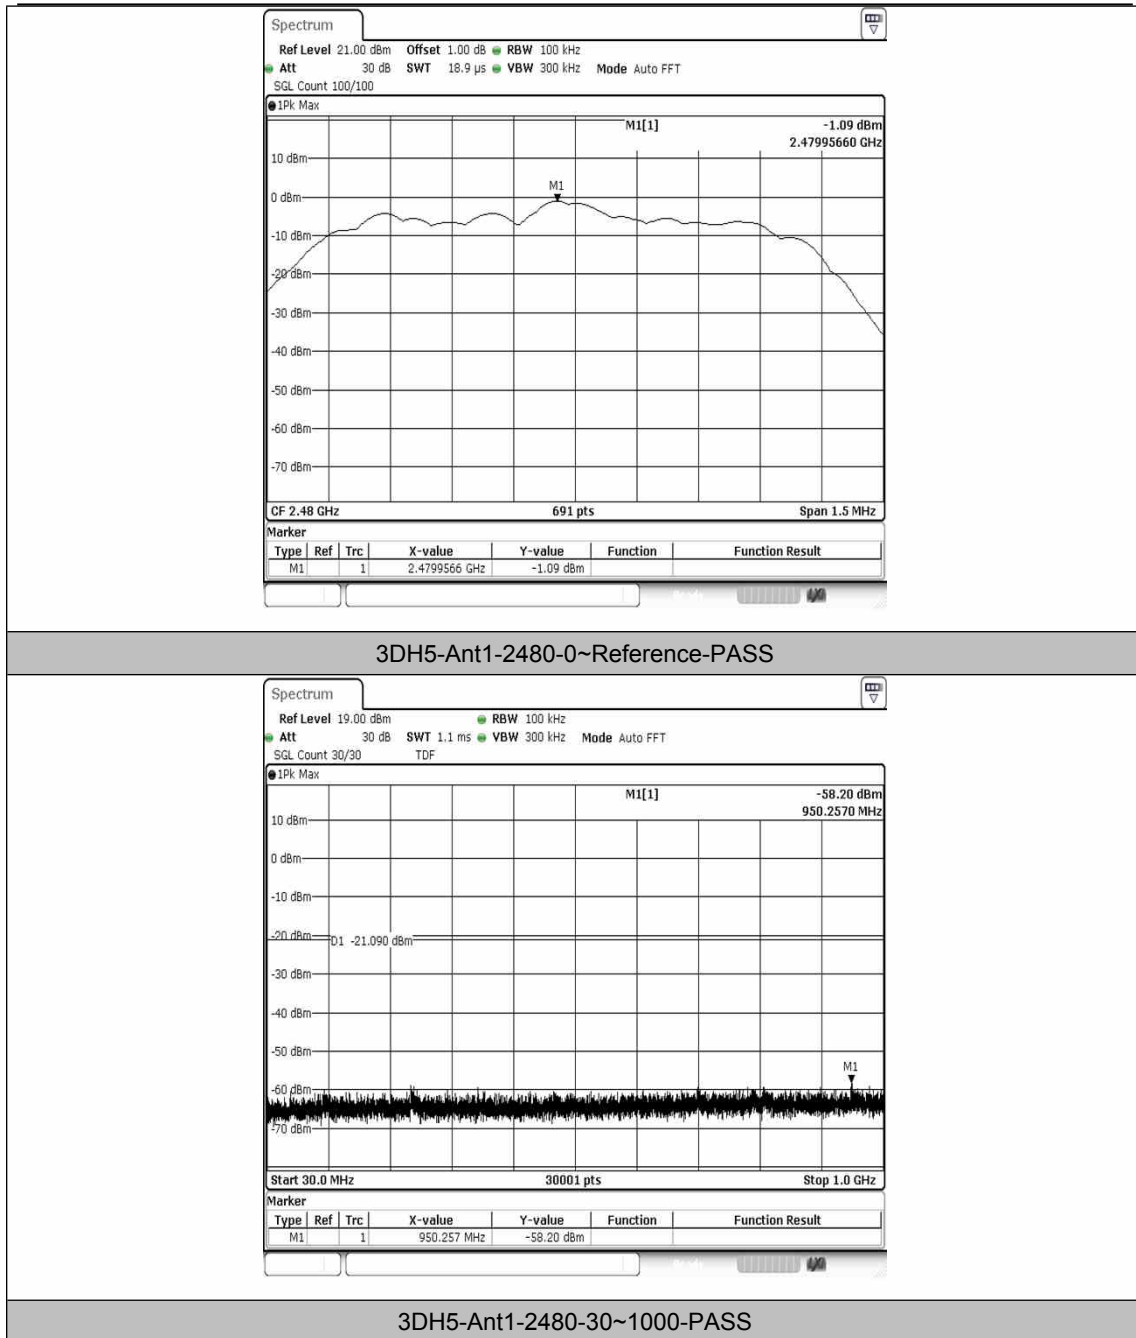

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

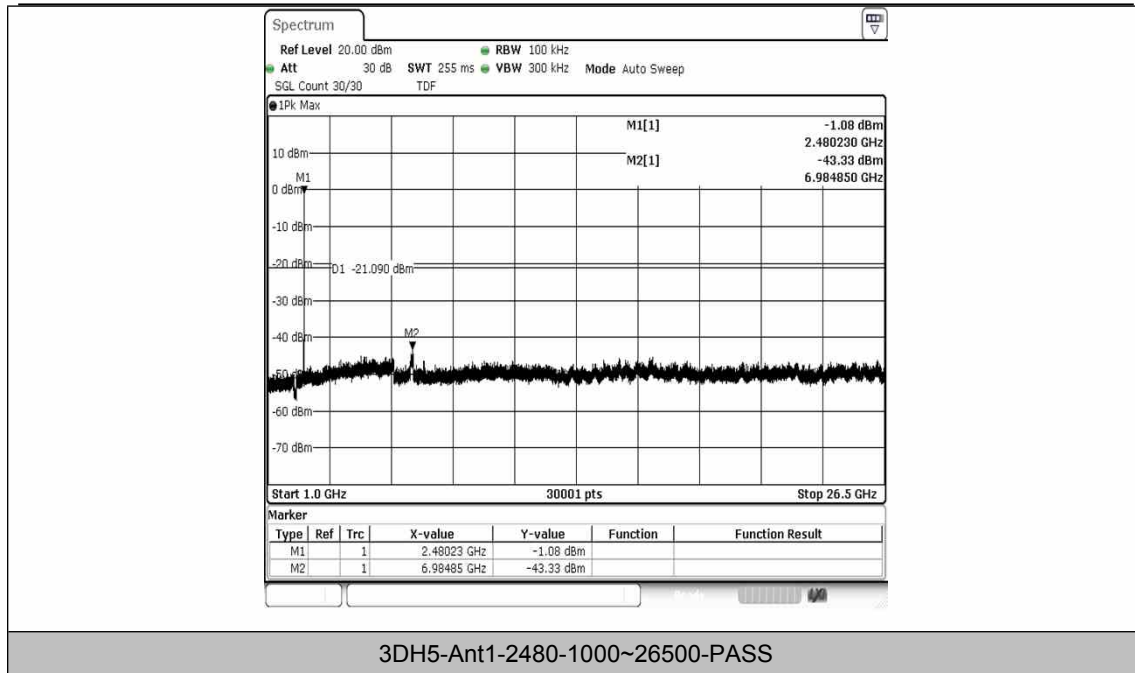

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix I: Duty Cycle


Test Result


Test Mode	Antenna	Frequency[MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	2.91	3.75	77.60	1.10
DH5	Ant1	2441	2.91	3.75	77.60	1.10
DH5	Ant1	2480	2.91	3.75	77.60	1.10
2DH5	Ant1	2402	2.92	3.76	77.66	1.10
2DH5	Ant1	2441	2.91	3.75	77.60	1.10
2DH5	Ant1	2480	2.91	3.75	77.60	1.10
3DH5	Ant1	2402	2.92	3.75	77.87	1.09
3DH5	Ant1	2441	2.93	3.75	78.13	1.07
3DH5	Ant1	2480	2.92	3.76	77.66	1.10


Test Graphs

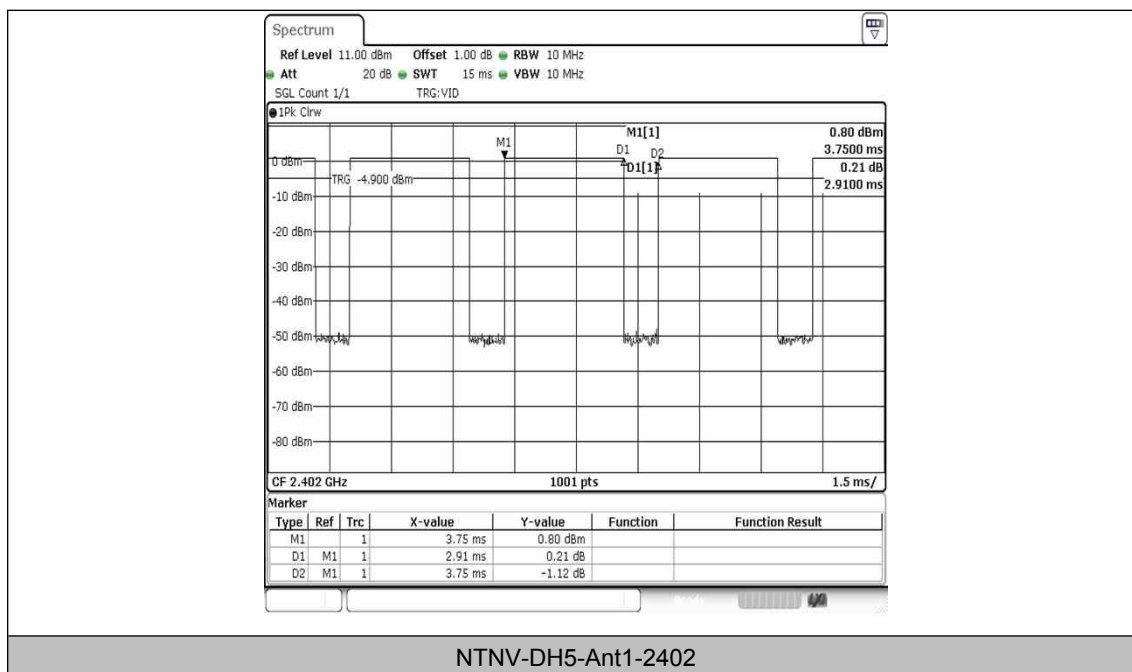

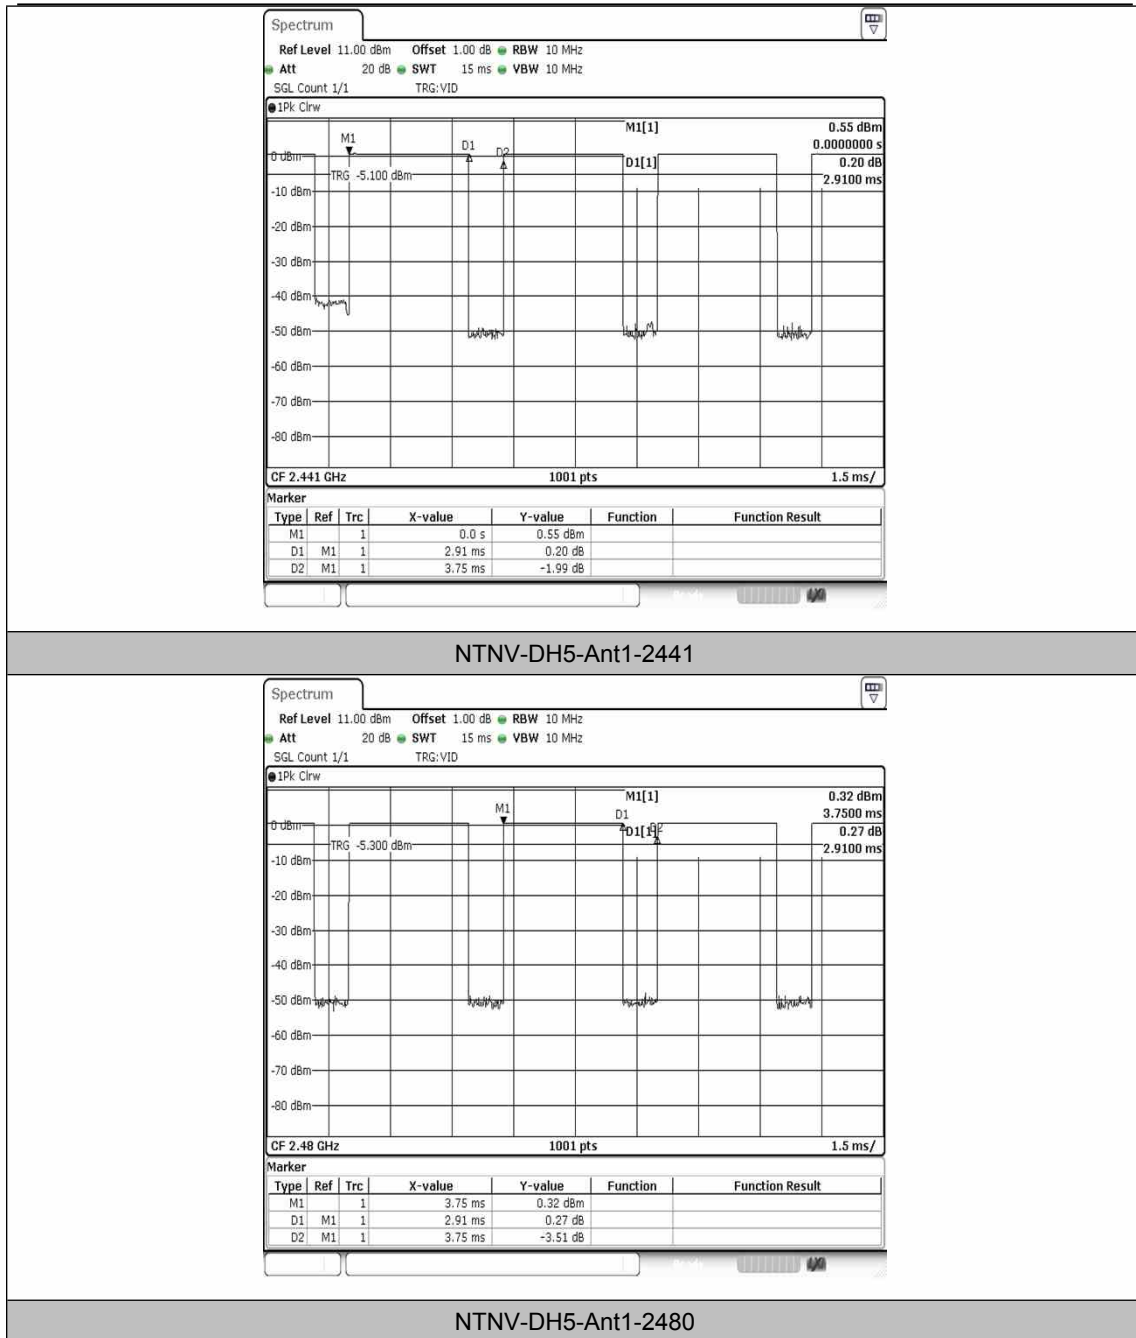

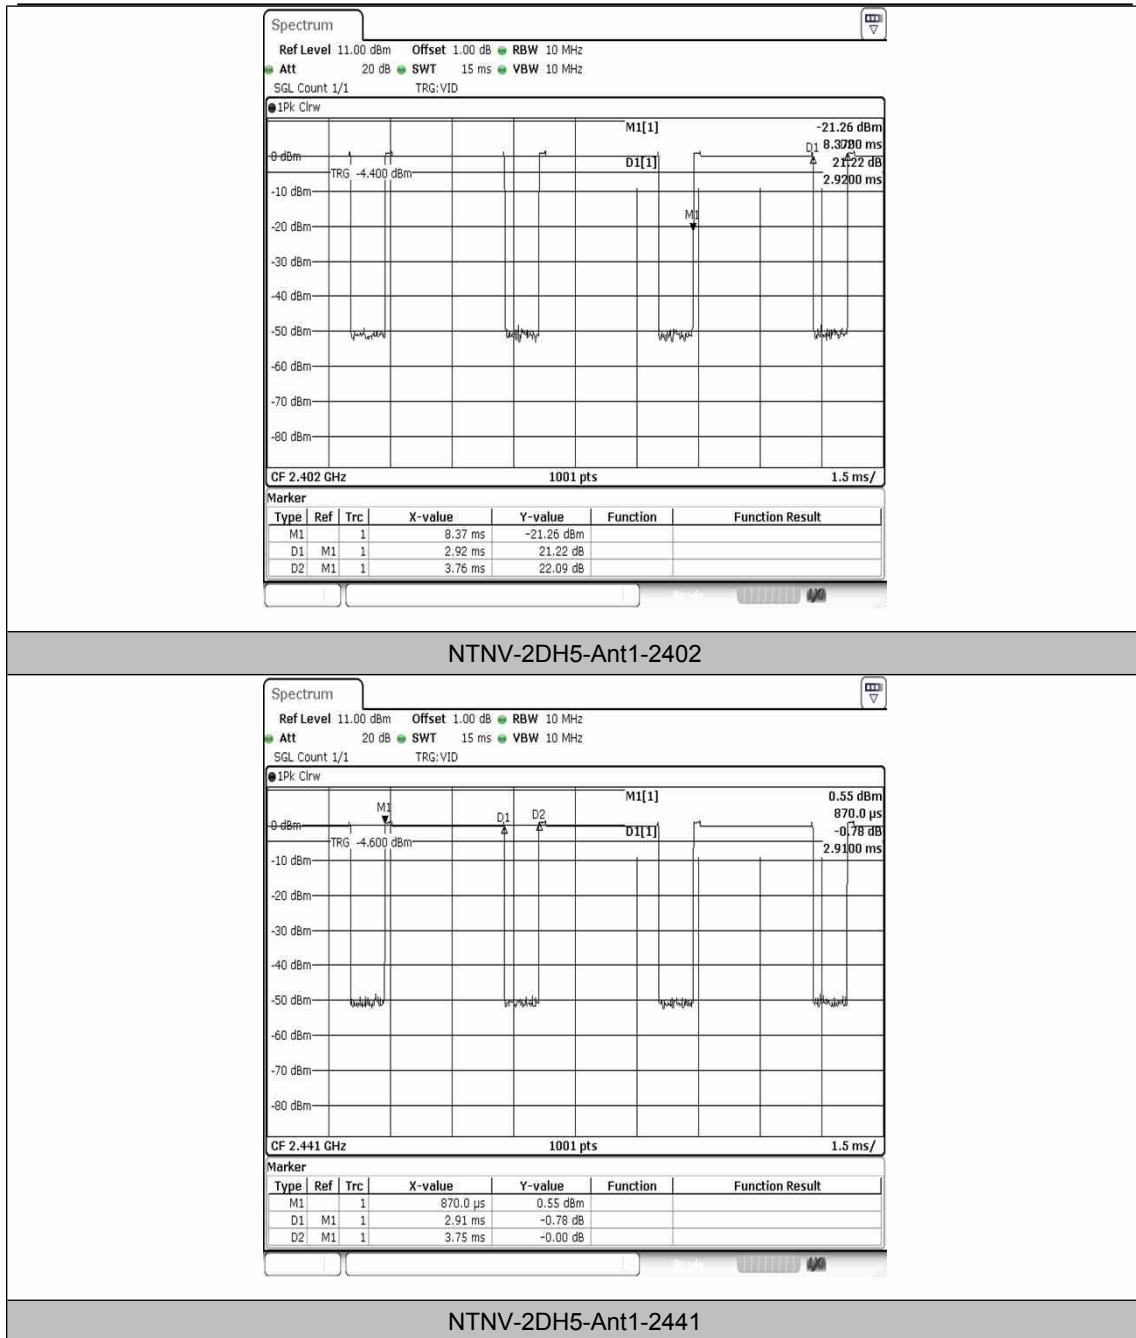

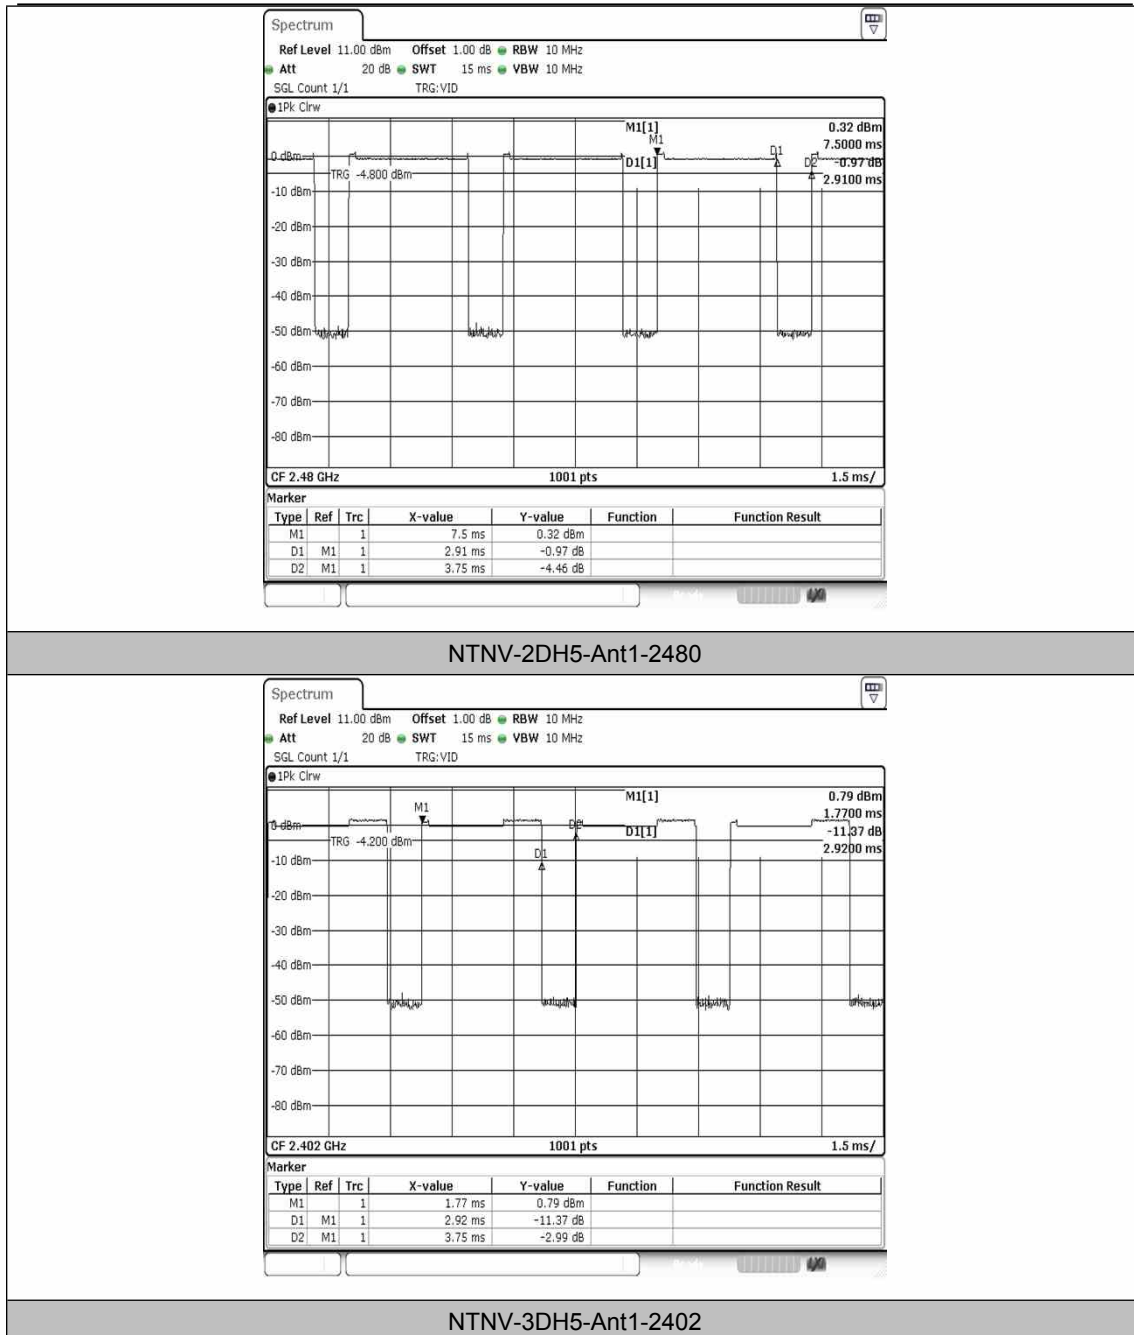

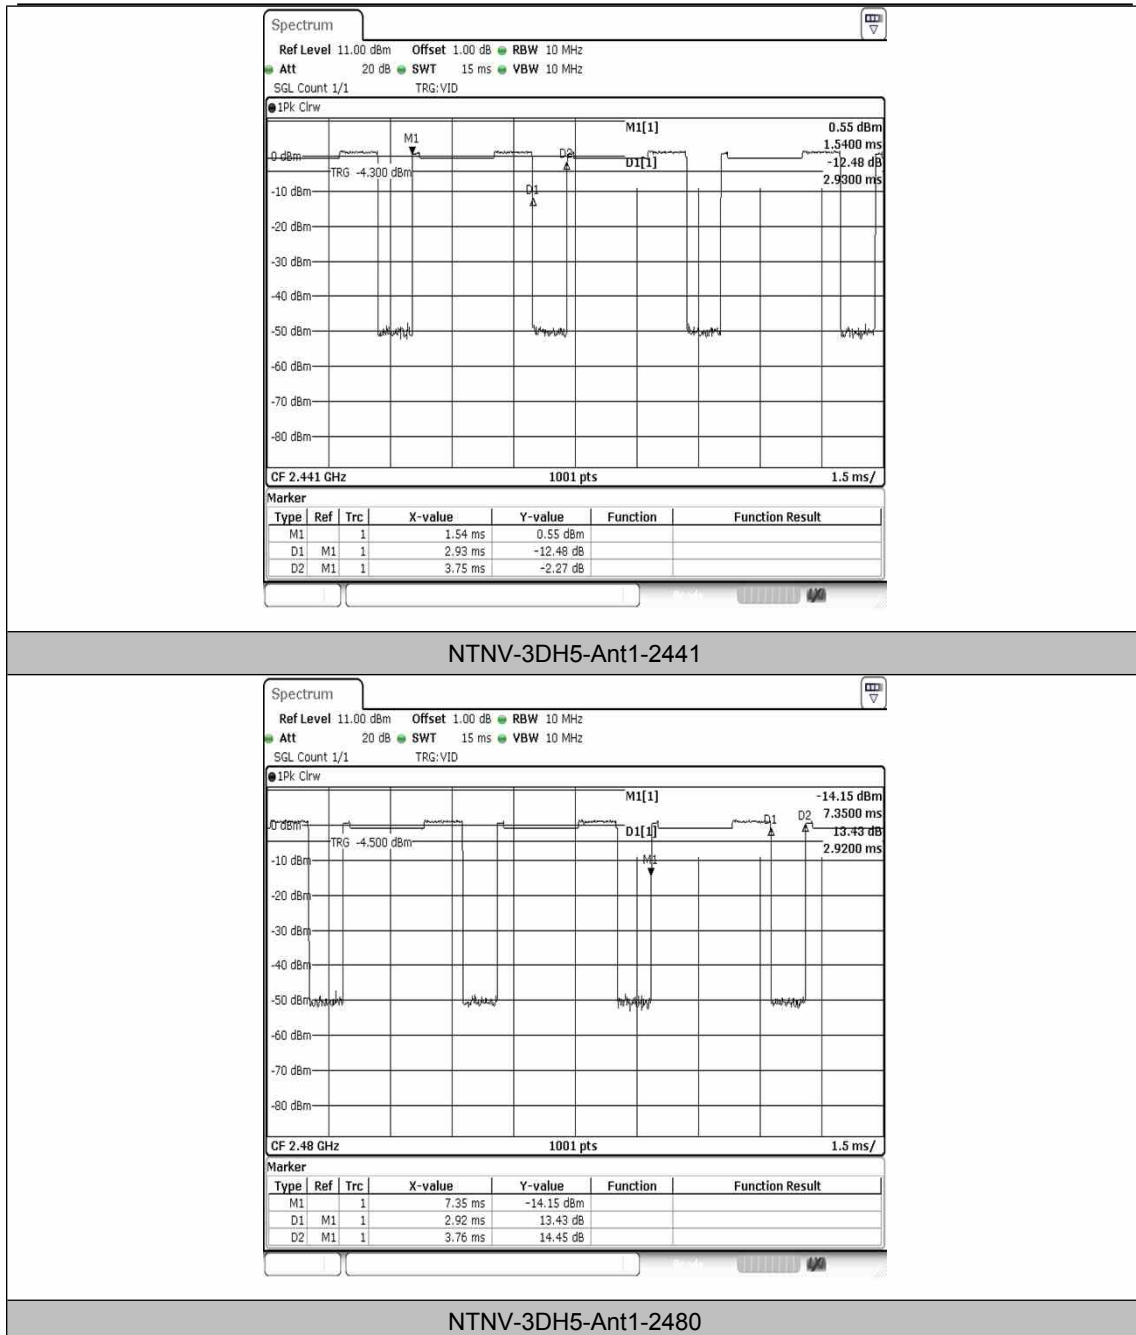

---End---