




Band4-5MHz-QPSK-19975-1RB#24



Band4-5MHz-QPSK-19975-25RB#0

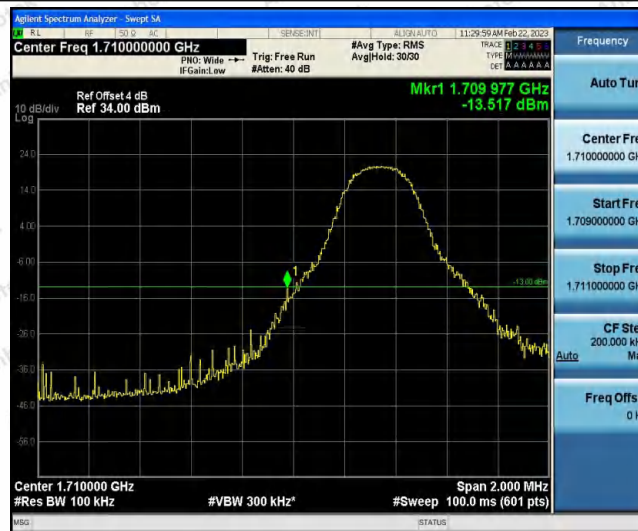

Band4-5MHz-QPSK-20375-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band4-5MHz-QPSK-20375-1RB#24

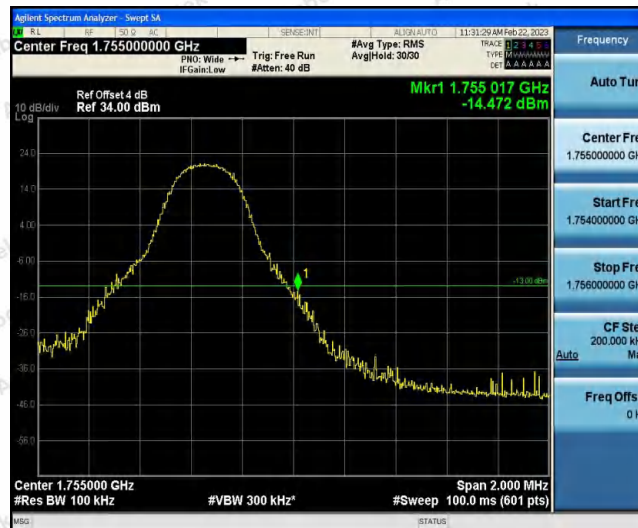


Band4-5MHz-QPSK-20375-25RB#0




Band4-5MHz-16QAM-19975-1RB#0



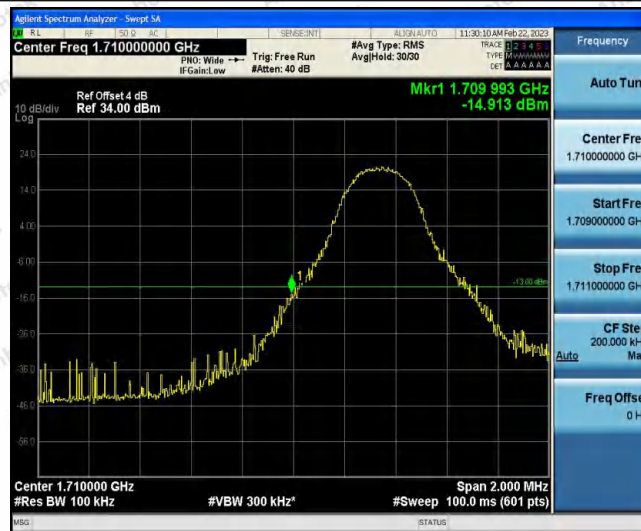

Band4-5MHz-16QAM-19975-1RB#24

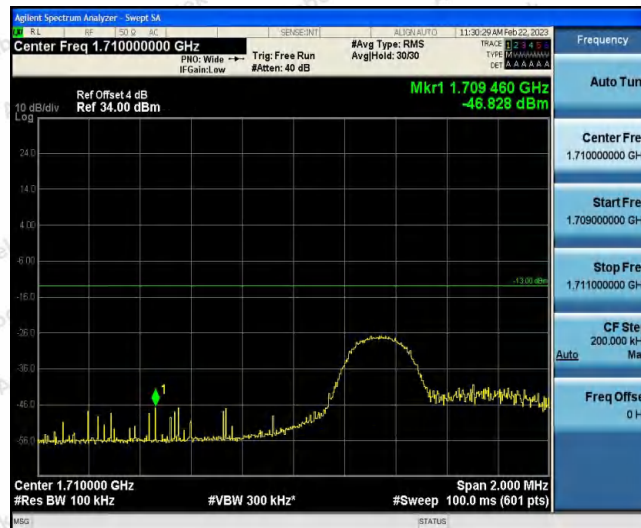

Band4-5MHz-16QAM-19975-25RB#0



Band4-5MHz-16QAM-20375-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band4-5MHz-16QAM-20375-1RB#24

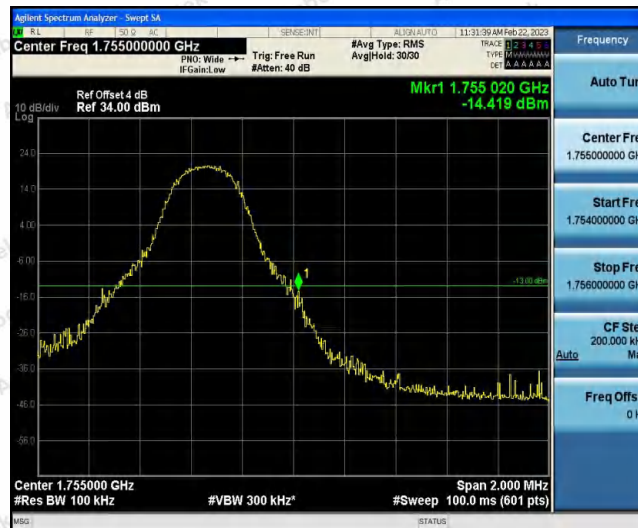

Band4-5MHz-16QAM-20375-25RB#0



Band4-10MHz-QPSK-20000-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band4-10MHz-QPSK-20000-1RB#49



Band4-10MHz-QPSK-20000-50RB#0



Band4-10MHz-QPSK-20350-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band4-10MHz-QPSK-20350-1RB#49



Band4-10MHz-QPSK-20350-50RB#0



Band4-10MHz-16QAM-20000-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band4-10MHz-16QAM-20000-1RB#49



Band4-10MHz-16QAM-20000-50RB#0



Band4-10MHz-16QAM-20350-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band4-10MHz-16QAM-20350-1RB#49



Band4-10MHz-16QAM-20350-50RB#0



Band4-15MHz-QPSK-20025-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band4-15MHz-QPSK-20025-1RB#74



Band4-15MHz-QPSK-20025-75RB#0



Band4-15MHz-QPSK-20325-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band4-15MHz-QPSK-20325-1RB#74



Band4-15MHz-QPSK-20325-75RB#0



Band4-15MHz-16QAM-20025-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band4-15MHz-16QAM-20025-1RB#74

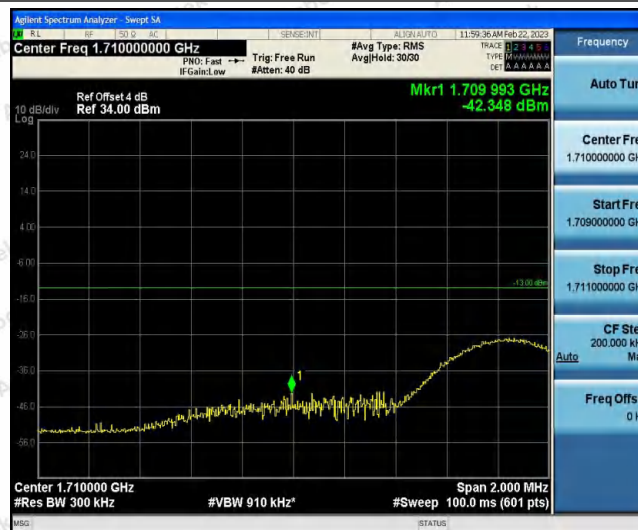

Band4-15MHz-16QAM-20025-75RB#0



Band4-15MHz-16QAM-20325-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band4-15MHz-16QAM-20325-1RB#74



Band4-15MHz-16QAM-20325-75RB#0



Band4-20MHz-QPSK-20050-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band4-20MHz-QPSK-20050-1RB#99



Band4-20MHz-QPSK-20050-100RB#0



Band4-20MHz-QPSK-20300-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



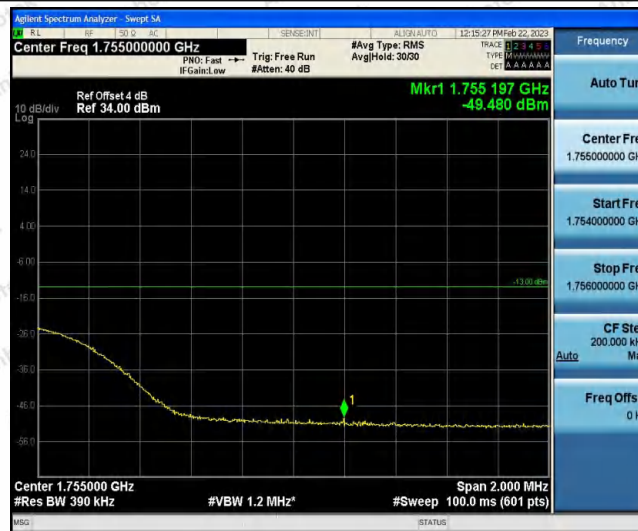

Band4-20MHz-QPSK-20300-1RB#99



Band4-20MHz-QPSK-20300-100RB#0



Band4-20MHz-16QAM-20050-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band4-20MHz-16QAM-20050-1RB#99



Band4-20MHz-16QAM-20050-100RB#0



Band4-20MHz-16QAM-20300-1RB#0

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com.cn





Band4-20MHz-16QAM-20300-1RB#99



Band4-20MHz-16QAM-20300-100RB#0



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band4	1.4MHz	QPSK	19957	1RB#0	Range1:30~1000MHz	-56.87	PASS
Band4	1.4MHz	QPSK	19957	1RB#0	Range2:1000~20000MHz	-32.37	PASS
Band4	1.4MHz	QPSK	20175	1RB#0	Range1:30~1000MHz	-56.37	PASS
Band4	1.4MHz	QPSK	20175	1RB#0	Range2:1000~20000MHz	-33.13	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	Range1:30~1000MHz	-57.38	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	Range2:1000~20000MHz	-33.81	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	Range1:30~1000MHz	-57.81	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	Range2:1000~20000MHz	-33.23	PASS
Band4	1.4MHz	16QAM	20175	1RB#0	Range1:30~1000MHz	-57.05	PASS
Band4	1.4MHz	16QAM	20175	1RB#0	Range2:1000~20000MHz	-33.89	PASS
Band4	1.4MHz	16QAM	20393	1RB#0	Range1:30~1000MHz	-56.25	PASS
Band4	1.4MHz	16QAM	20393	1RB#0	Range2:1000~20000MHz	-33.46	PASS
Band4	3MHz	QPSK	19965	1RB#0	Range1:30~1000MHz	-57.27	PASS
Band4	3MHz	QPSK	19965	1RB#0	Range2:1000~20000MHz	-32.87	PASS
Band4	3MHz	QPSK	20175	1RB#0	Range1:30~1000MHz	-56.96	PASS
Band4	3MHz	QPSK	20175	1RB#0	Range2:1000~20000MHz	-33.52	PASS
Band4	3MHz	QPSK	20385	1RB#0	Range1:30~1000MHz	-57.18	PASS
Band4	3MHz	QPSK	20385	1RB#0	Range2:1000~20000MHz	-33.47	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band4	3MHz	16QAM	19965	1RB#0	Range1:30~1000MHz	-56.65	PASS
Band4	3MHz	16QAM	19965	1RB#0	Range2:1000~20000MHz	-33.07	PASS
Band4	3MHz	16QAM	20175	1RB#0	Range1:30~1000MHz	-57.27	PASS
Band4	3MHz	16QAM	20175	1RB#0	Range2:1000~20000MHz	-33.03	PASS
Band4	3MHz	16QAM	20385	1RB#0	Range1:30~1000MHz	-57.78	PASS
Band4	3MHz	16QAM	20385	1RB#0	Range2:1000~20000MHz	-33.51	PASS
Band4	5MHz	QPSK	19975	1RB#0	Range1:30~1000MHz	-56.98	PASS
Band4	5MHz	QPSK	19975	1RB#0	Range2:1000~20000MHz	-31.97	PASS
Band4	5MHz	QPSK	20175	1RB#0	Range1:30~1000MHz	-57.27	PASS
Band4	5MHz	QPSK	20175	1RB#0	Range2:1000~20000MHz	-32.93	PASS
Band4	5MHz	QPSK	20375	1RB#0	Range1:30~1000MHz	-56.72	PASS
Band4	5MHz	QPSK	20375	1RB#0	Range2:1000~20000MHz	-33.52	PASS
Band4	5MHz	16QAM	19975	1RB#0	Range1:30~1000MHz	-56.91	PASS
Band4	5MHz	16QAM	19975	1RB#0	Range2:1000~20000MHz	-33.32	PASS
Band4	5MHz	16QAM	20175	1RB#0	Range1:30~1000MHz	-57.74	PASS
Band4	5MHz	16QAM	20175	1RB#0	Range2:1000~20000MHz	-33.38	PASS
Band4	5MHz	16QAM	20375	1RB#0	Range1:30~1000MHz	-56.25	PASS
Band4	5MHz	16QAM	20375	1RB#0	Range2:1000~20000MHz	-32.86	PASS
Band4	10MHz	QPSK	20000	1RB#0	Range1:30~1000MHz	-57.41	PASS
Band4	10MHz	QPSK	20000	1RB#0	Range2:1000~20000MHz	-33.55	PASS
Band4	10MHz	QPSK	20175	1RB#0	Range1:30~1000MHz	-57.19	PASS
Band4	10MHz	QPSK	20175	1RB#0	Range2:1000~20000MHz	-33.6	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band4	10MHz	QPSK	20350	1RB#0	Range1:30~1000MHz	-56.71	PASS
Band4	10MHz	QPSK	20350	1RB#0	Range2:1000~20000MHz	-33.86	PASS
Band4	10MHz	16QAM	20000	1RB#0	Range1:30~1000MHz	-57.46	PASS
Band4	10MHz	16QAM	20000	1RB#0	Range2:1000~20000MHz	-33.94	PASS
Band4	10MHz	16QAM	20175	1RB#0	Range1:30~1000MHz	-57.04	PASS
Band4	10MHz	16QAM	20175	1RB#0	Range2:1000~20000MHz	-32.34	PASS
Band4	10MHz	16QAM	20350	1RB#0	Range1:30~1000MHz	-57.06	PASS
Band4	10MHz	16QAM	20350	1RB#0	Range2:1000~20000MHz	-33.58	PASS
Band4	15MHz	QPSK	20025	1RB#0	Range1:30~1000MHz	-57.5	PASS
Band4	15MHz	QPSK	20025	1RB#0	Range2:1000~20000MHz	-29.51	PASS
Band4	15MHz	QPSK	20175	1RB#0	Range1:30~1000MHz	-57.26	PASS
Band4	15MHz	QPSK	20175	1RB#0	Range2:1000~20000MHz	-33.25	PASS
Band4	15MHz	QPSK	20325	1RB#0	Range1:30~1000MHz	-57.24	PASS
Band4	15MHz	QPSK	20325	1RB#0	Range2:1000~20000MHz	-33.23	PASS
Band4	15MHz	16QAM	20025	1RB#0	Range1:30~1000MHz	-56.94	PASS
Band4	15MHz	16QAM	20025	1RB#0	Range2:1000~20000MHz	-33.21	PASS
Band4	15MHz	16QAM	20175	1RB#0	Range1:30~1000MHz	-56.67	PASS
Band4	15MHz	16QAM	20175	1RB#0	Range2:1000~20000MHz	-33	PASS
Band4	15MHz	16QAM	20325	1RB#0	Range1:30~1000MHz	-57.34	PASS
Band4	15MHz	16QAM	20325	1RB#0	Range2:1000~20000MHz	-33.44	PASS
Band4	20MHz	QPSK	20050	1RB#0	Range1:30~1000MHz	-56.86	PASS
Band4	20MHz	QPSK	20050	1RB#0	Range2:1000~20000MHz	-32.59	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com.cn



Band4	20MHz	QPSK	20175	1RB#0	Range1:30~1000MHz	-57.44	PASS
Band4	20MHz	QPSK	20175	1RB#0	Range2:1000~20000MHz	-33.19	PASS
Band4	20MHz	QPSK	20300	1RB#0	Range1:30~1000MHz	-56.87	PASS
Band4	20MHz	QPSK	20300	1RB#0	Range2:1000~20000MHz	-33.77	PASS
Band4	20MHz	16QAM	20050	1RB#0	Range1:30~1000MHz	-57.39	PASS
Band4	20MHz	16QAM	20050	1RB#0	Range2:1000~20000MHz	-32.44	PASS
Band4	20MHz	16QAM	20175	1RB#0	Range1:30~1000MHz	-57.32	PASS
Band4	20MHz	16QAM	20175	1RB#0	Range2:1000~20000MHz	-33.19	PASS
Band4	20MHz	16QAM	20300	1RB#0	Range1:30~1000MHz	-56.82	PASS
Band4	20MHz	16QAM	20300	1RB#0	Range2:1000~20000MHz	-33	PASS

Test Graphs

Band4-1.4MHz-QPSK-19957-1RB#0-Range1:30~1000MHz

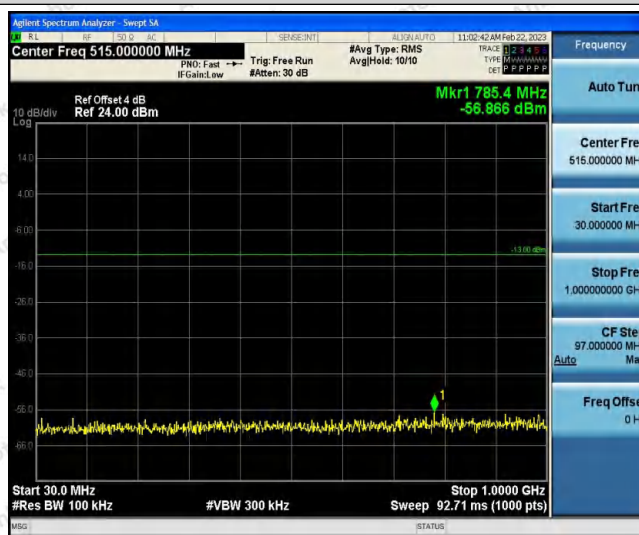

Band4-1.4MHz-QPSK-19957-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




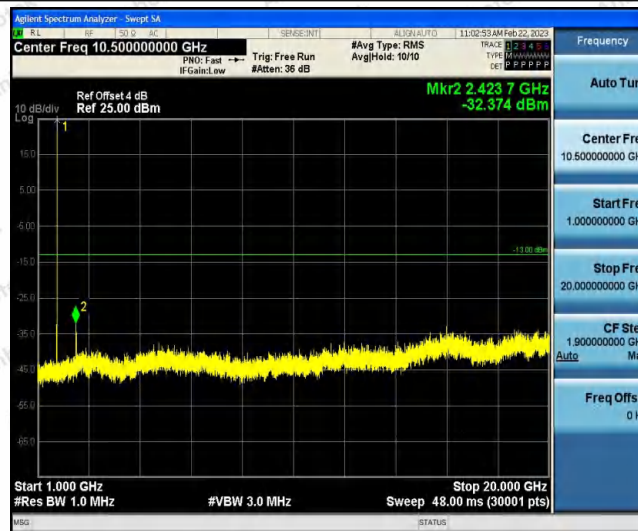

Band4-1.4MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

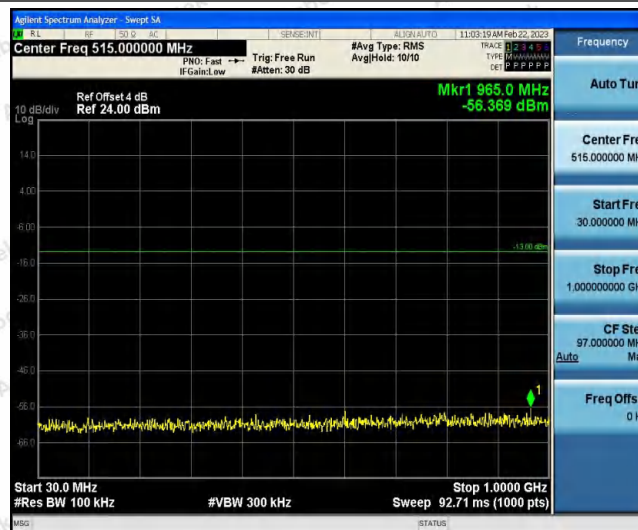


Band4-1.4MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

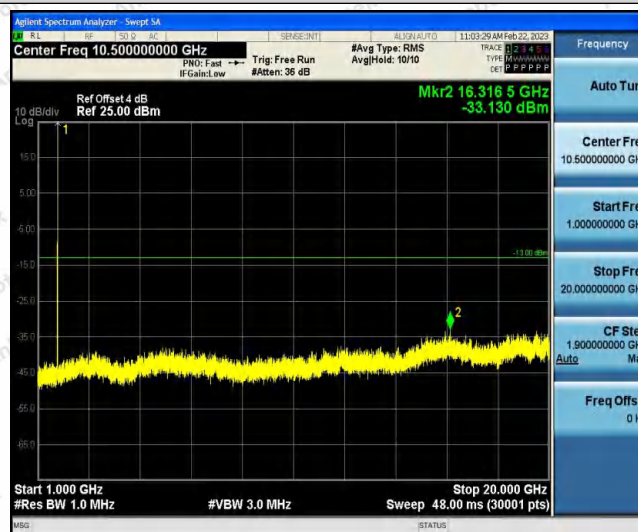


Band4-1.4MHz-QPSK-20393-1RB#0-Range1:30~1000MHz




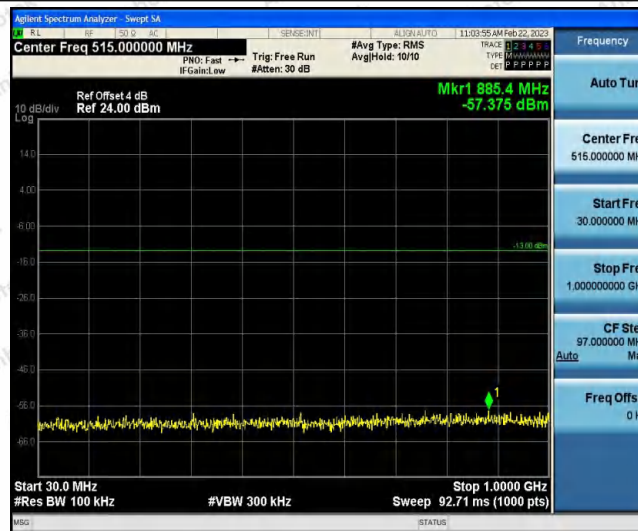

Band4-1.4MHz-QPSK-20393-1RB#0-Range2:1000~20000MHz

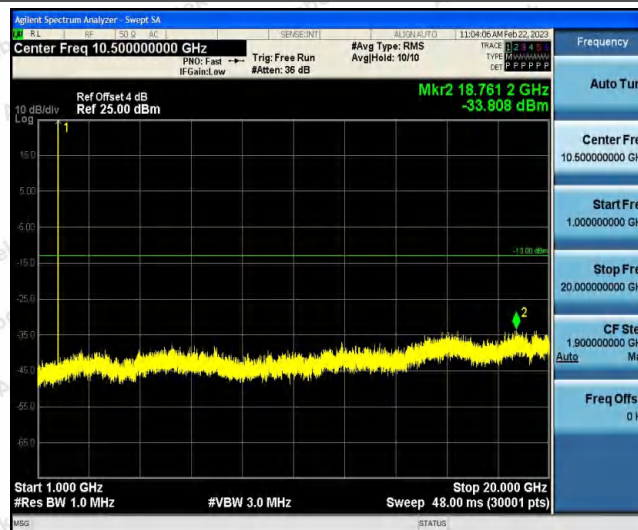

Band4-1.4MHz-16QAM-19957-1RB#0-Range1:30~1000MHz

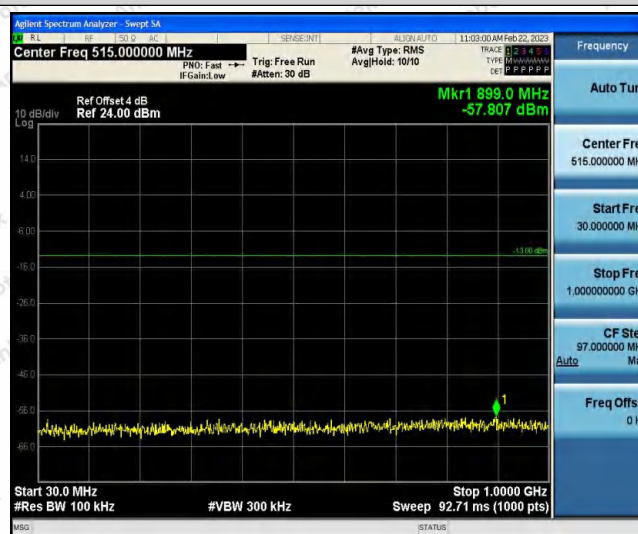

Band4-1.4MHz-16QAM-19957-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




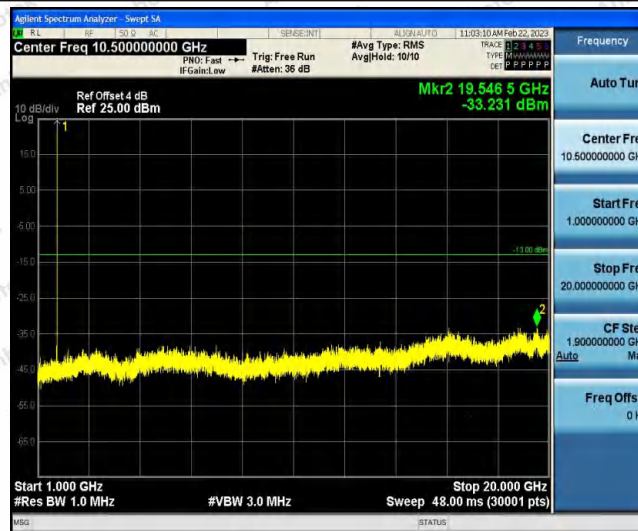

Band4-1.4MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

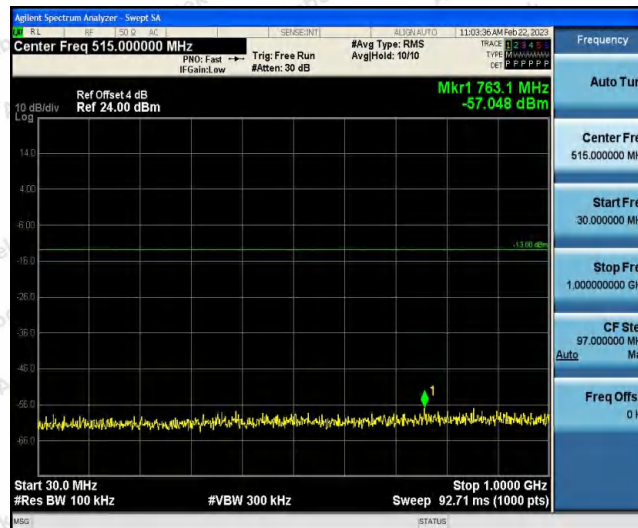

Band4-1.4MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

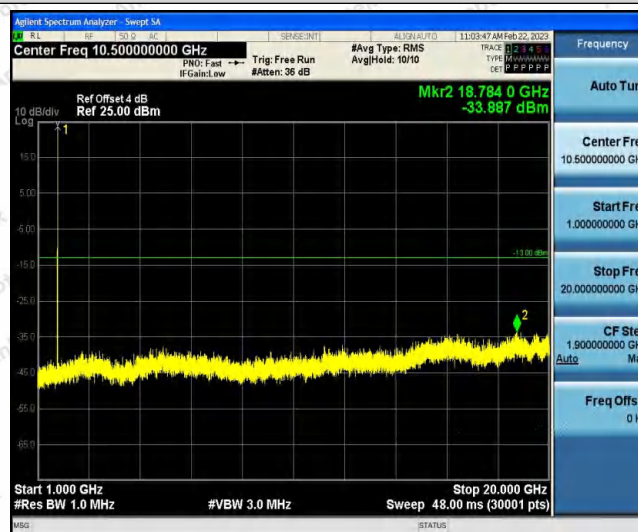

Band4-1.4MHz-16QAM-20393-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




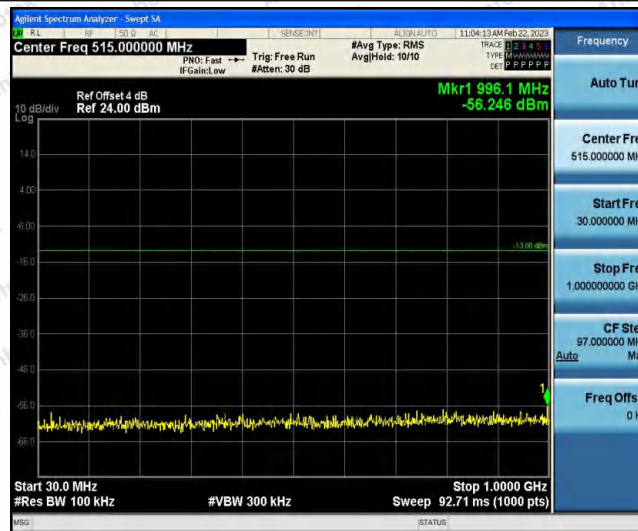

Band4-1.4MHz-16QAM-20393-1RB#0-Range2:1000~20000MHz

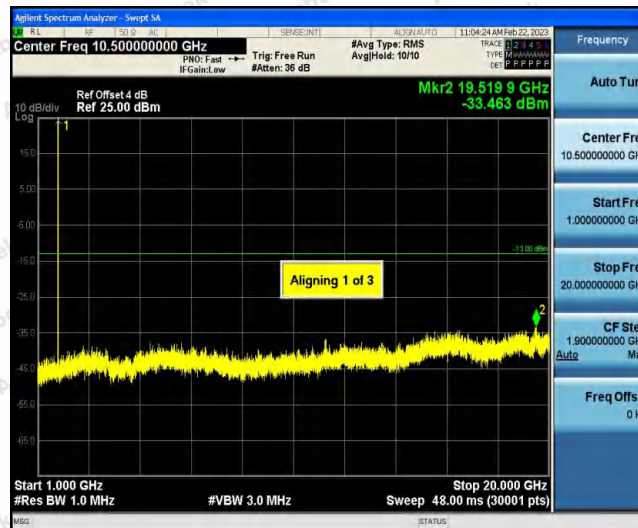

Band4-3MHz-QPSK-19965-1RB#0-Range1:30~1000MHz

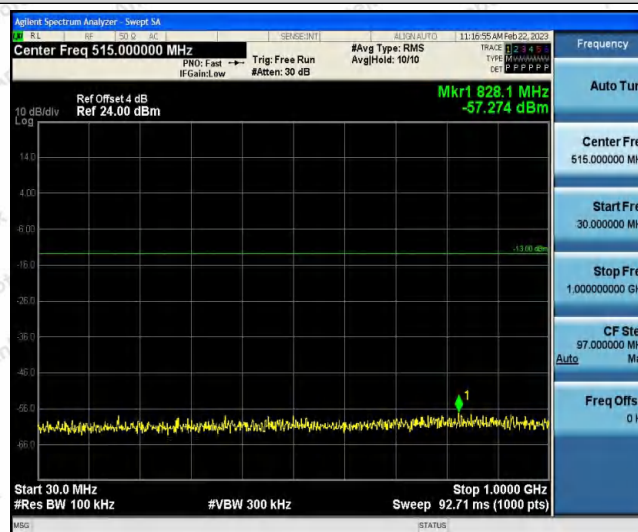

Band4-3MHz-QPSK-19965-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




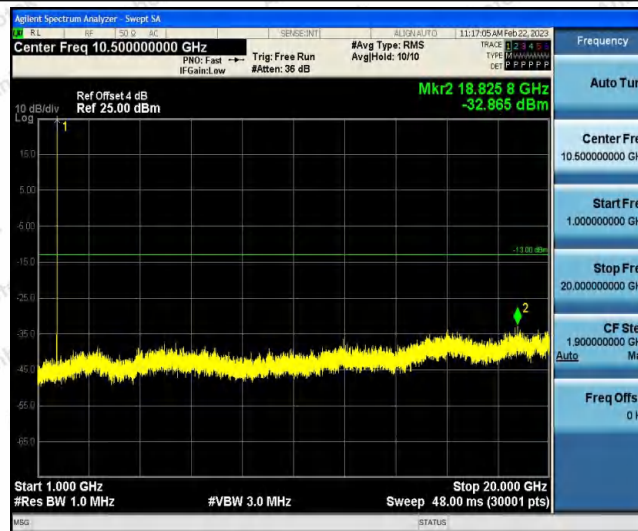

Band4-3MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

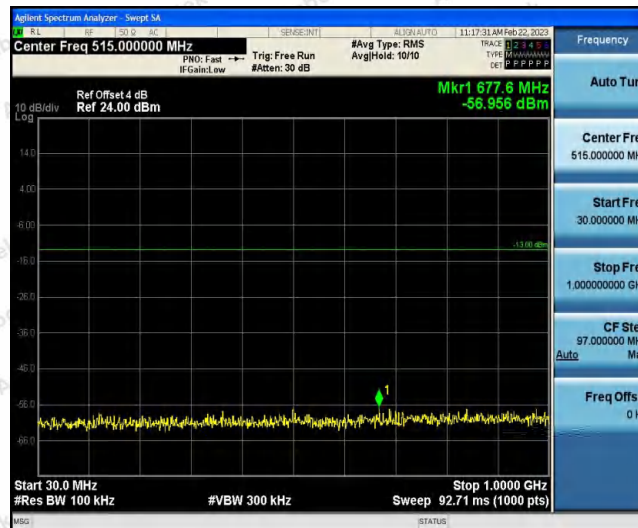

Band4-3MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

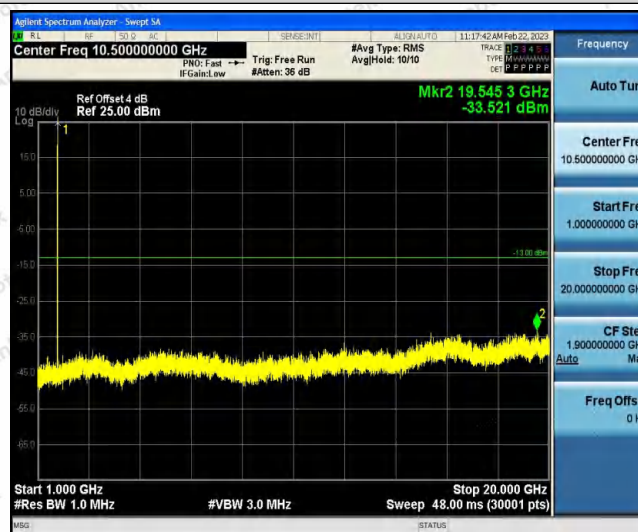

Band4-3MHz-QPSK-20385-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




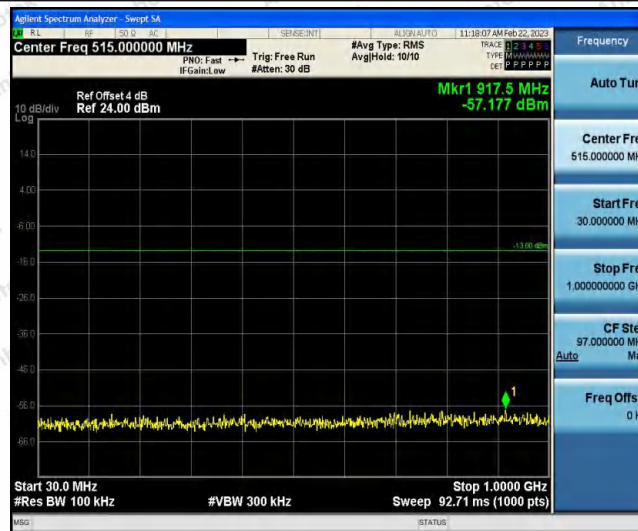

Band4-3MHz-QPSK-20385-1RB#0-Range2:1000~20000MHz

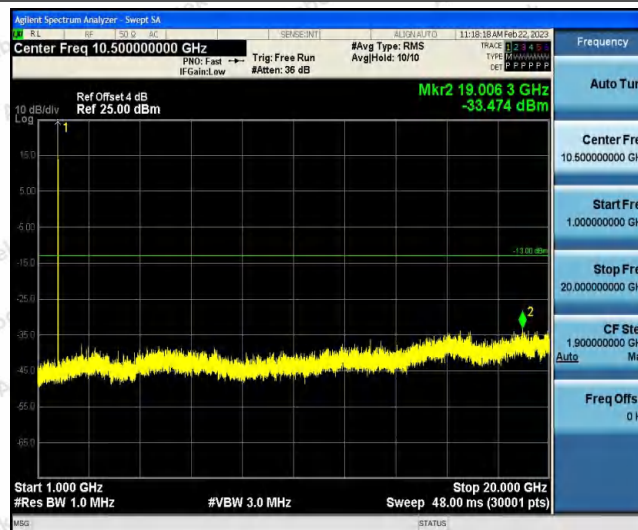

Band4-3MHz-16QAM-19965-1RB#0-Range1:30~1000MHz

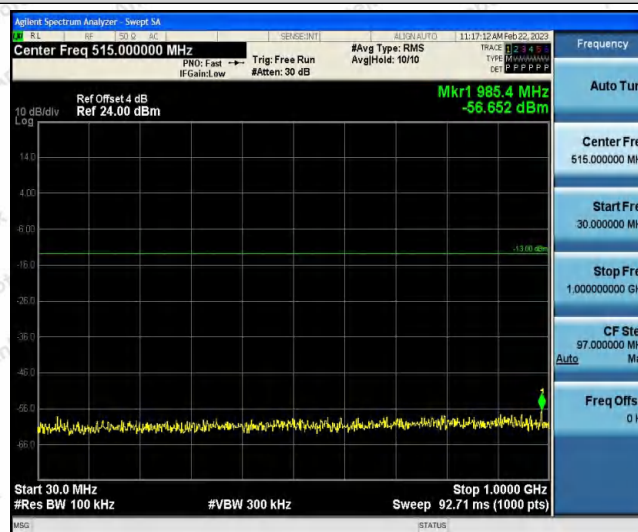

Band4-3MHz-16QAM-19965-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




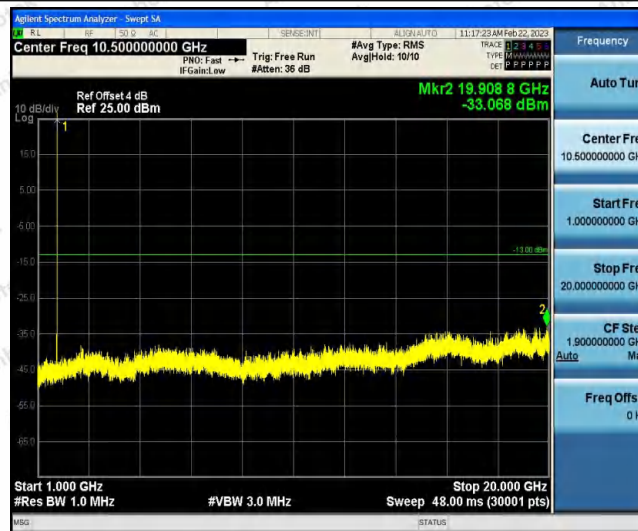

Band4-3MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

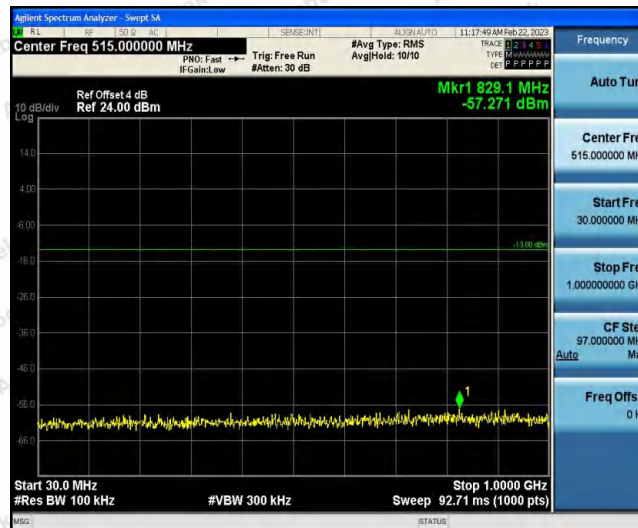

Band4-3MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

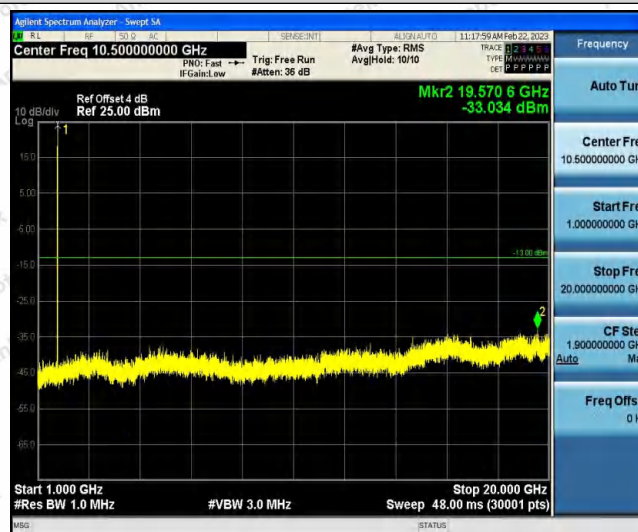

Band4-3MHz-16QAM-20385-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




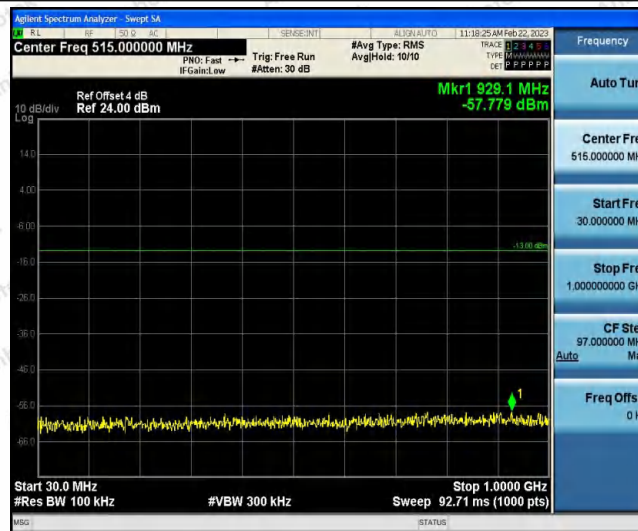

Band4-3MHz-16QAM-20385-1RB#0-Range2:1000~20000MHz



Band4-5MHz-QPSK-19975-1RB#0-Range1:30~1000MHz

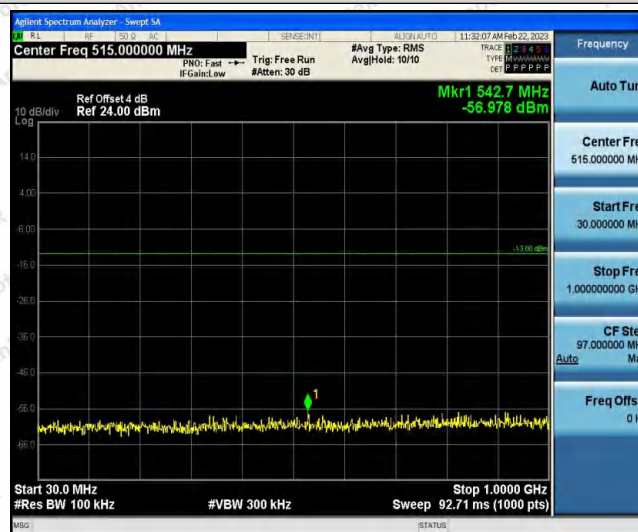

Band4-5MHz-QPSK-19975-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




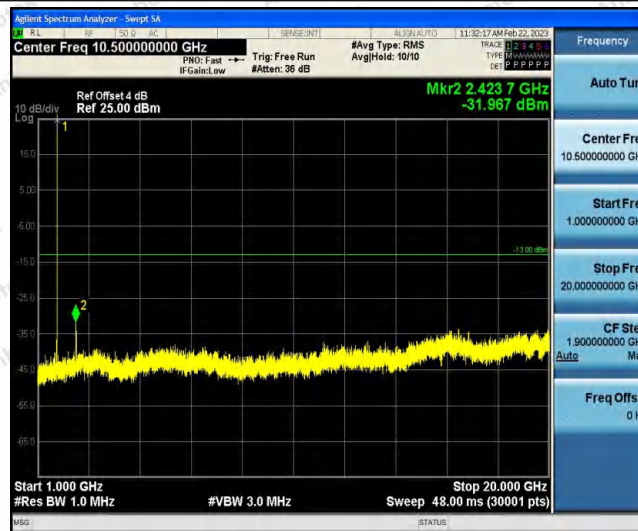

Band4-5MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

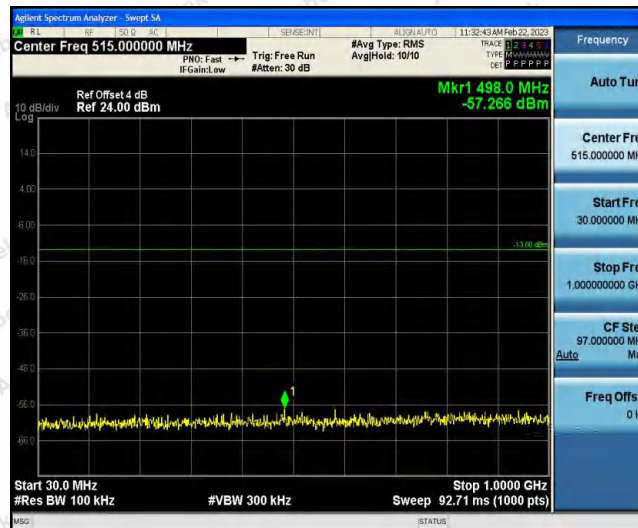

Band4-5MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

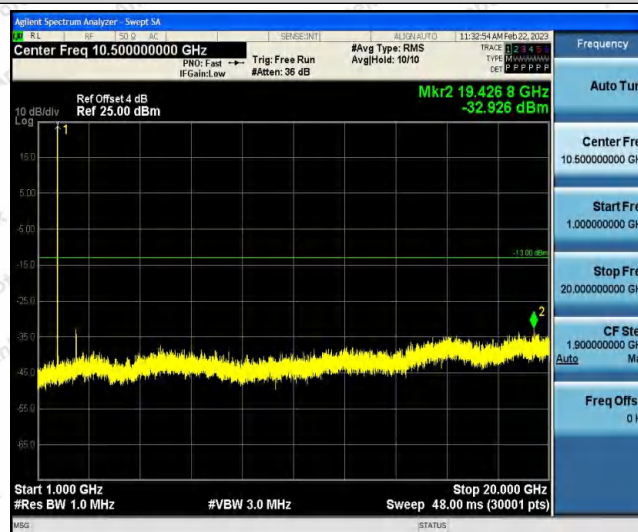

Band4-5MHz-QPSK-20375-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




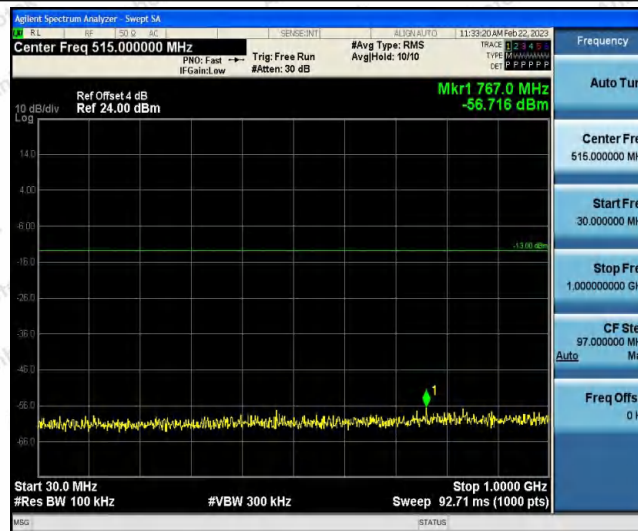

Band4-5MHz-QPSK-20375-1RB#0-Range2:1000~20000MHz

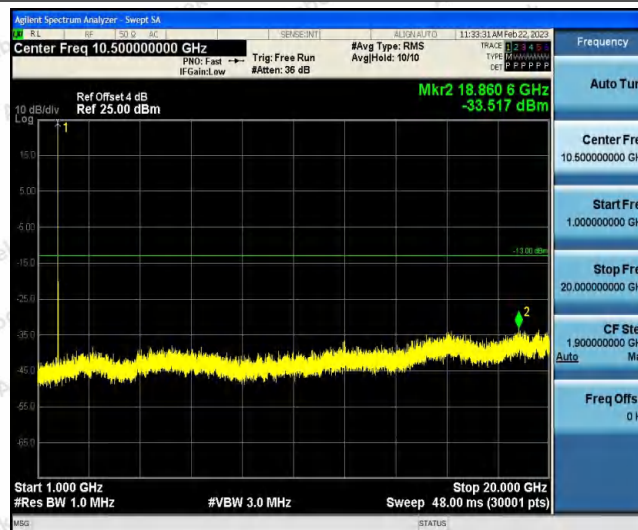

Band4-5MHz-16QAM-19975-1RB#0-Range1:30~1000MHz

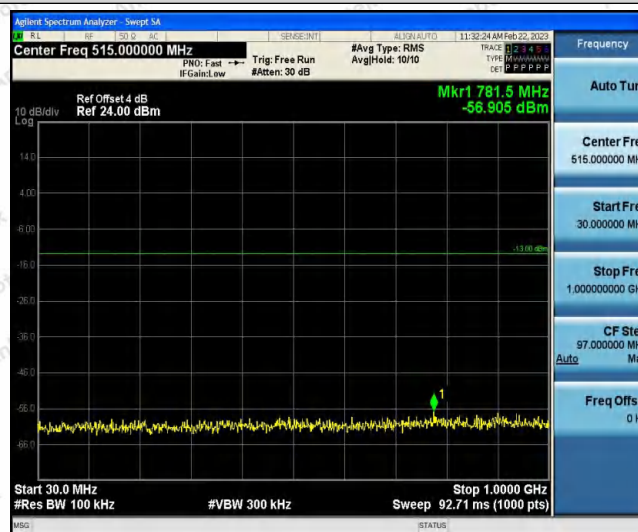

Band4-5MHz-16QAM-19975-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band4-5MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

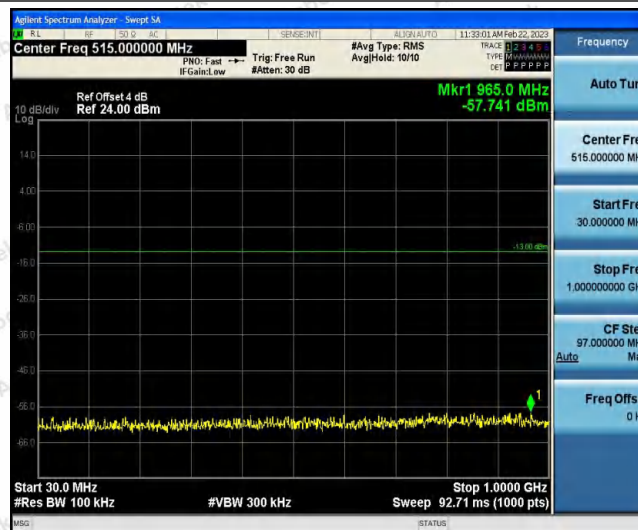

Band4-5MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

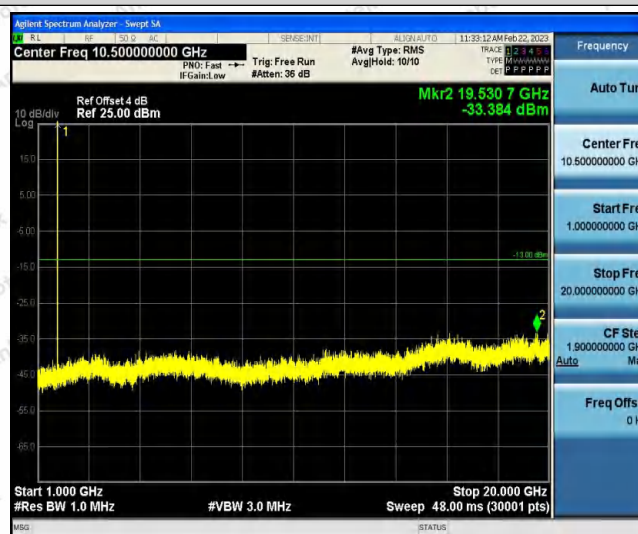


Band4-5MHz-16QAM-20375-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
www.anbotek.com.cn




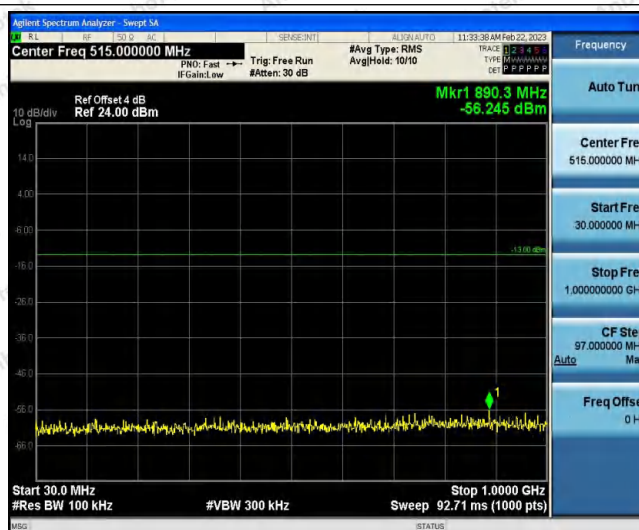

Band4-5MHz-16QAM-20375-1RB#0-Range2:1000~20000MHz

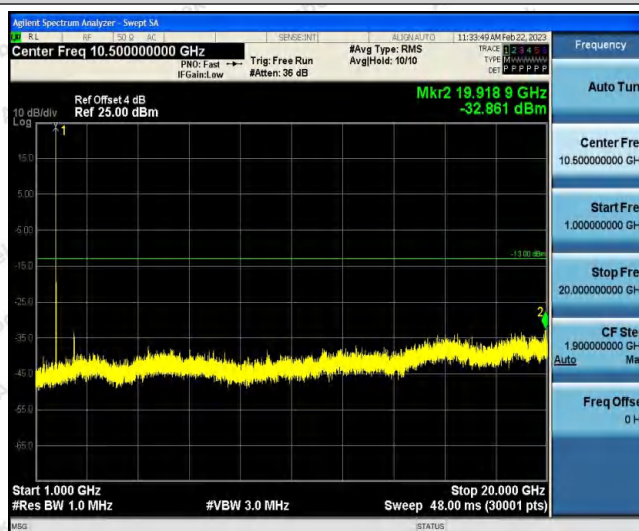

Band4-10MHz-QPSK-20000-1RB#0-Range1:30~1000MHz

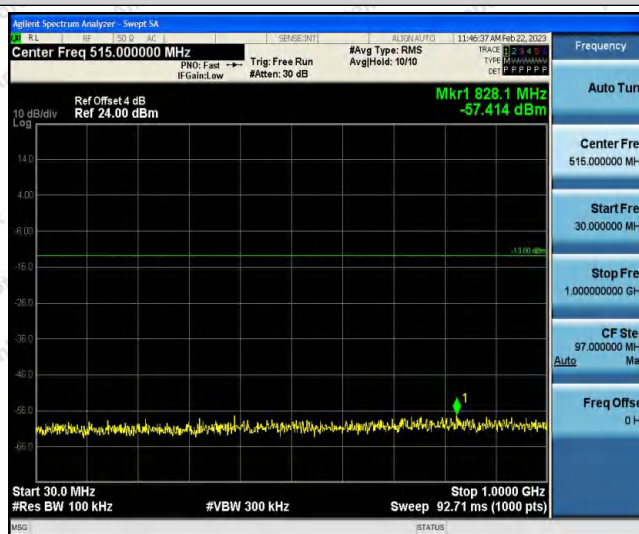

Band4-10MHz-QPSK-20000-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




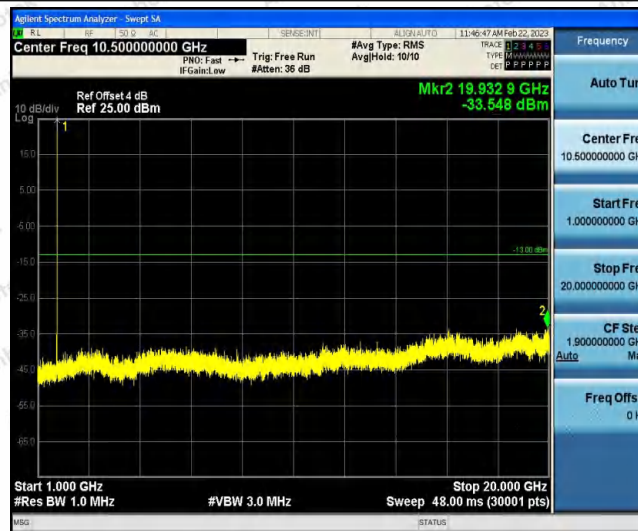

Band4-10MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

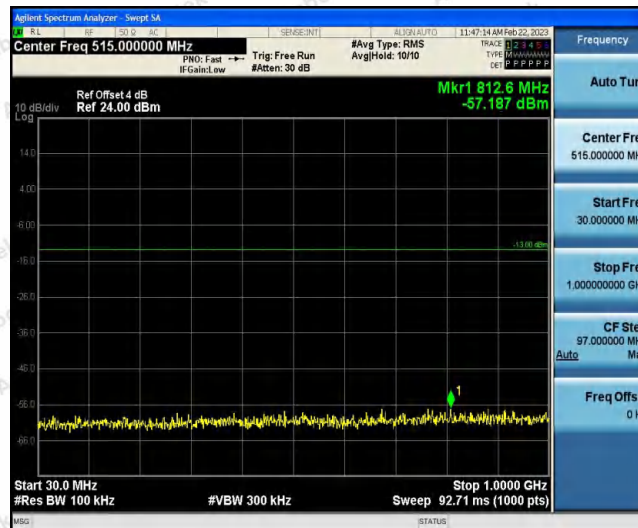

Band4-10MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

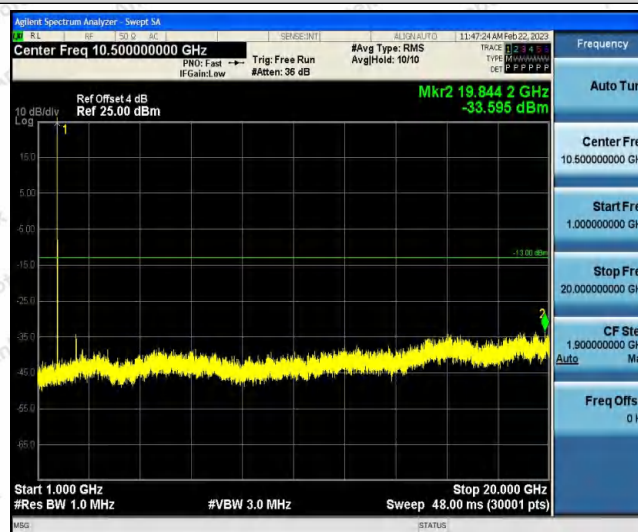

Band4-10MHz-QPSK-20350-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




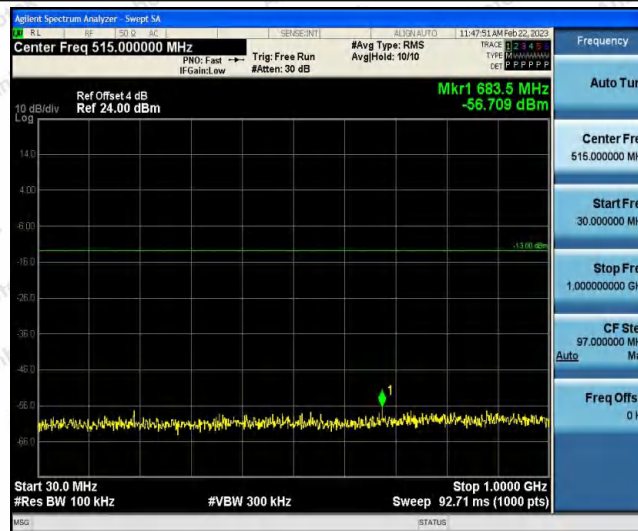

Band4-10MHz-QPSK-20350-1RB#0-Range2:1000~20000MHz

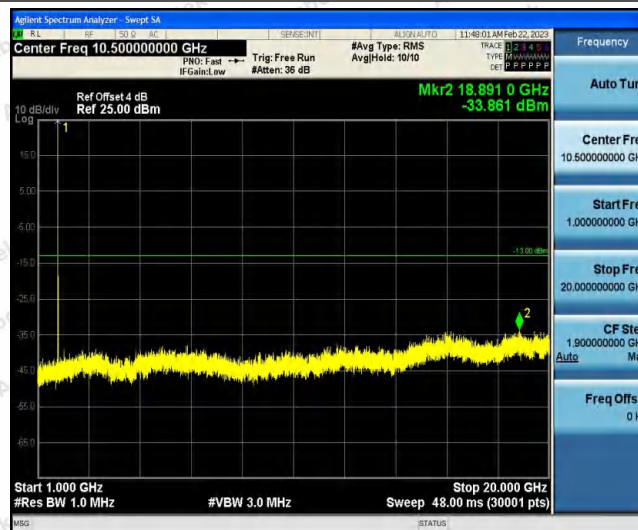

Band4-10MHz-16QAM-20000-1RB#0-Range1:30~1000MHz

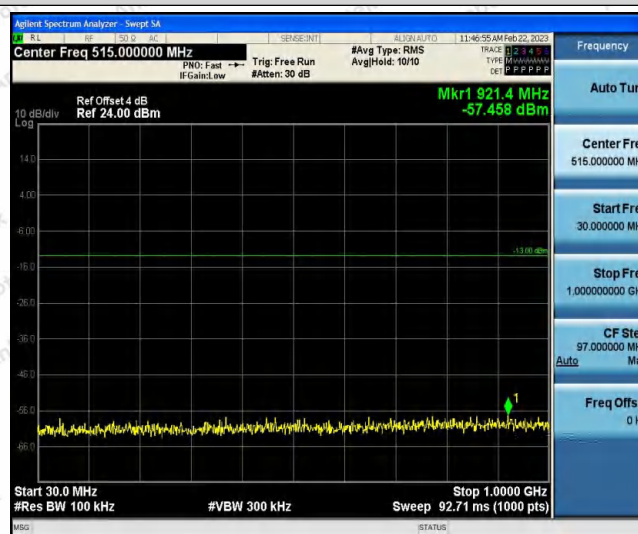

Band4-10MHz-16QAM-20000-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




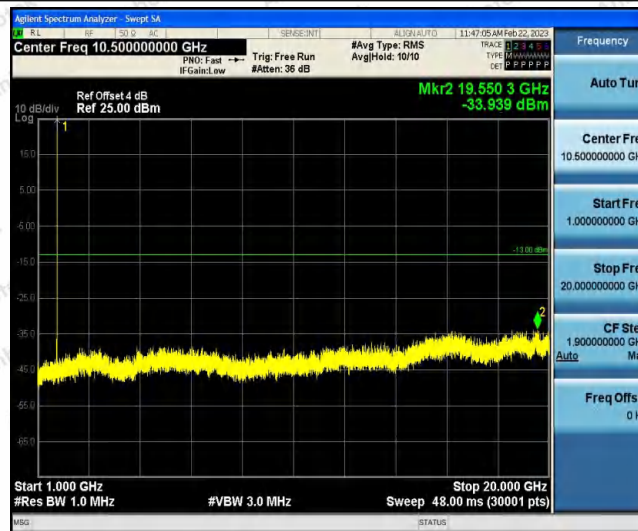

Band4-10MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

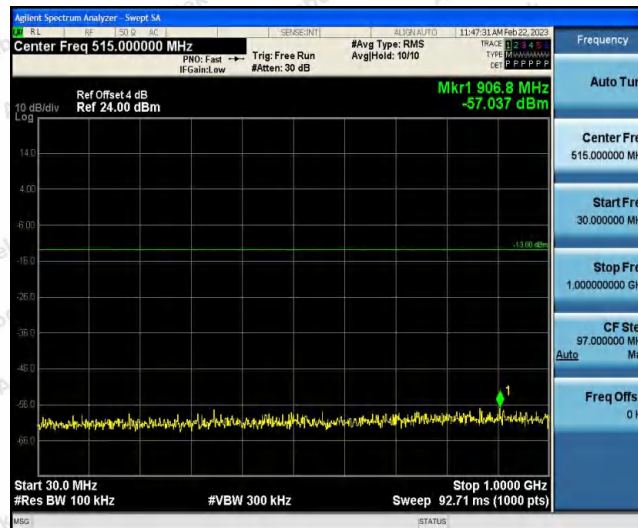

Band4-10MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

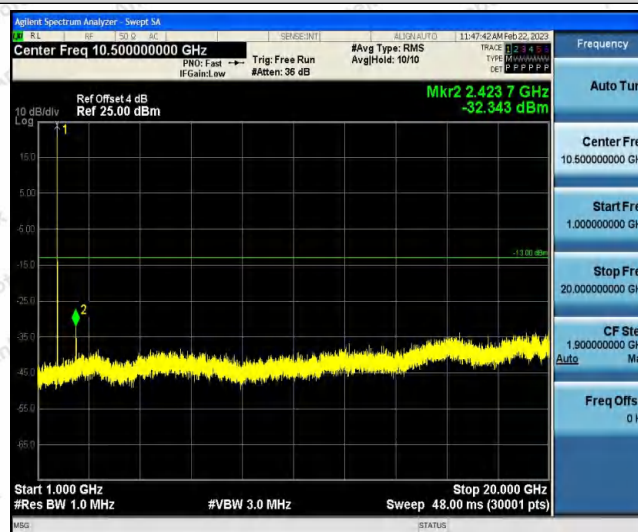

Band4-10MHz-16QAM-20350-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




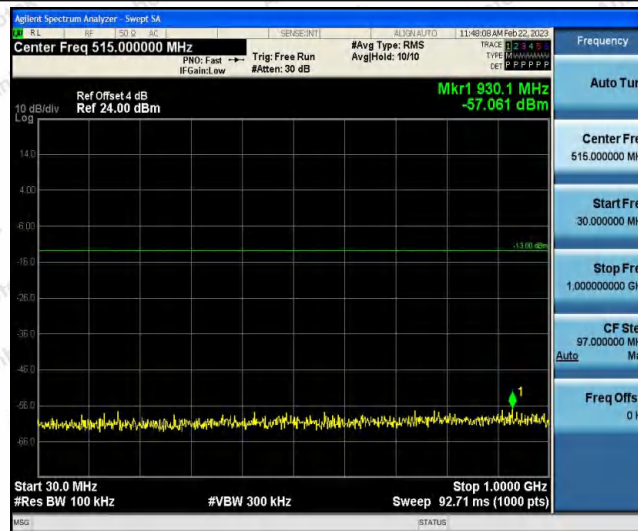

Band4-10MHz-16QAM-20350-1RB#0-Range2:1000~20000MHz

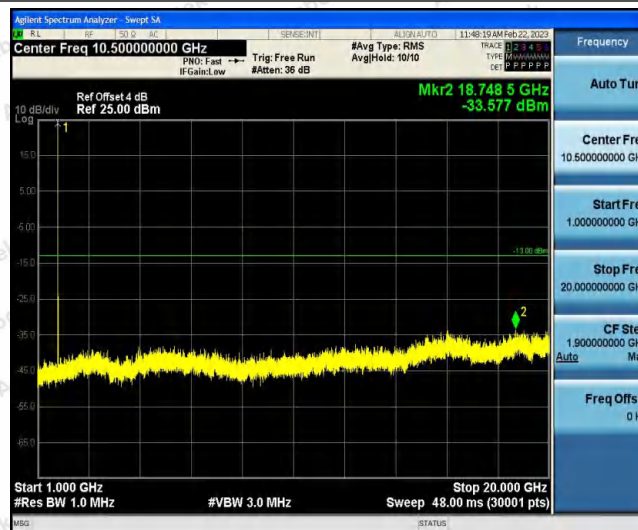

Band4-15MHz-QPSK-20025-1RB#0-Range1:30~1000MHz

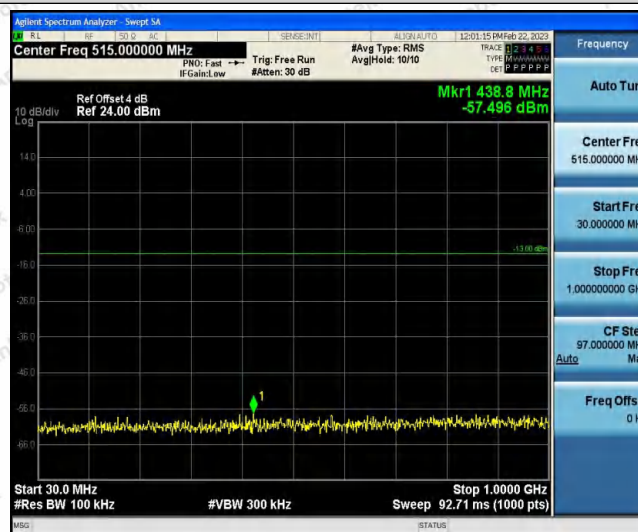

Band4-15MHz-QPSK-20025-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




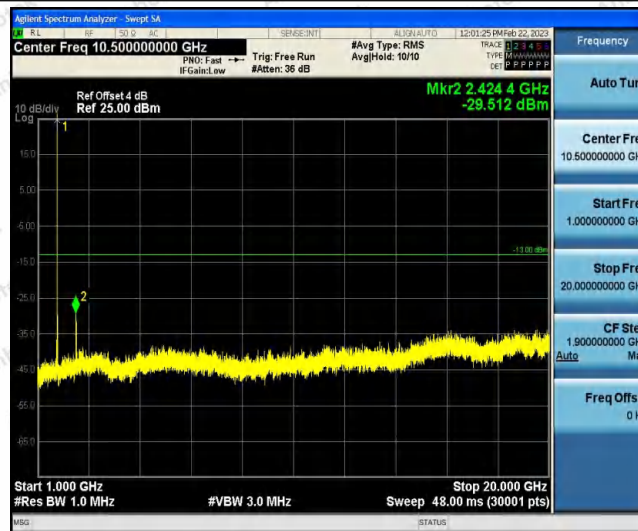

Band4-15MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

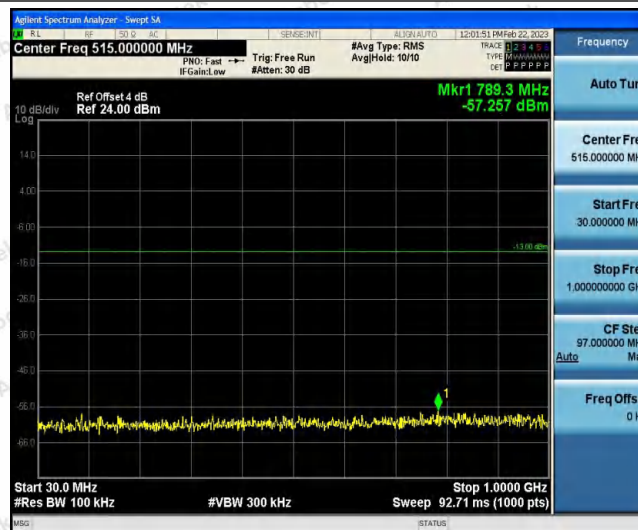


Band4-15MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

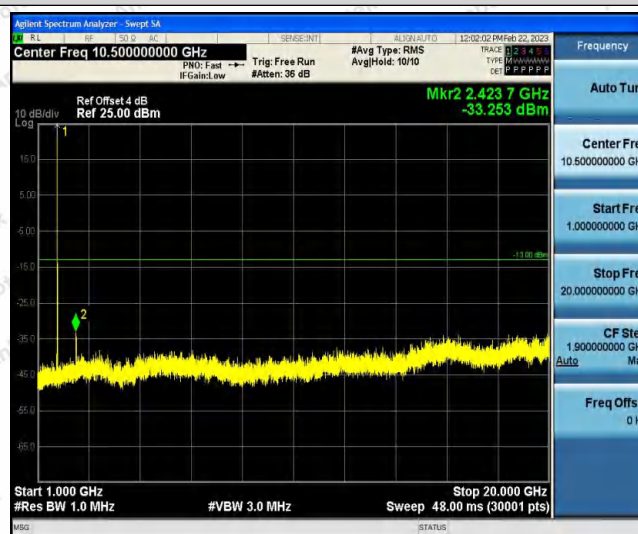


Band4-15MHz-QPSK-20325-1RB#0-Range1:30~1000MHz




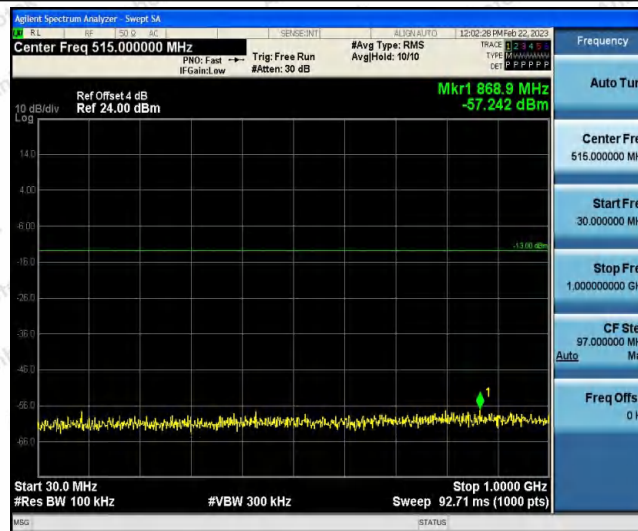

Band4-15MHz-QPSK-20325-1RB#0-Range2:1000~20000MHz

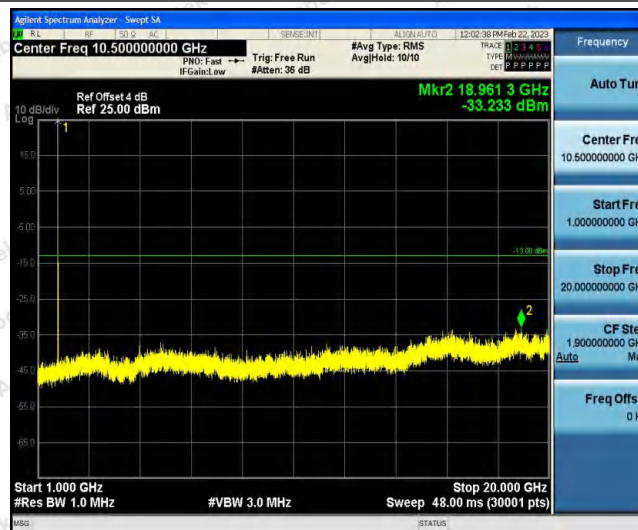

Band4-15MHz-16QAM-20025-1RB#0-Range1:30~1000MHz

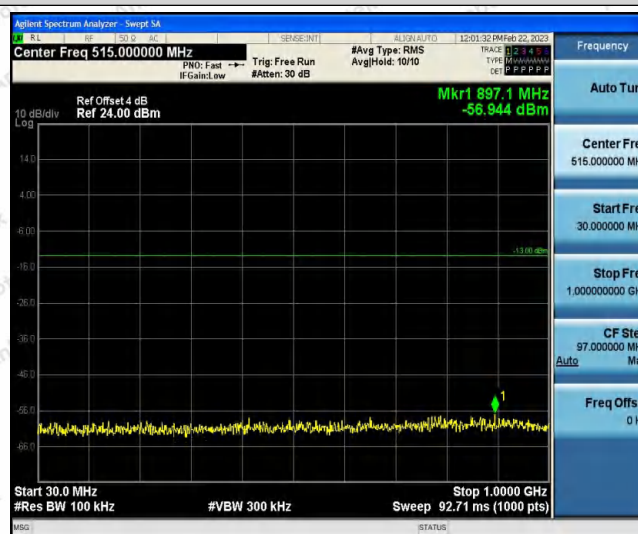

Band4-15MHz-16QAM-20025-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




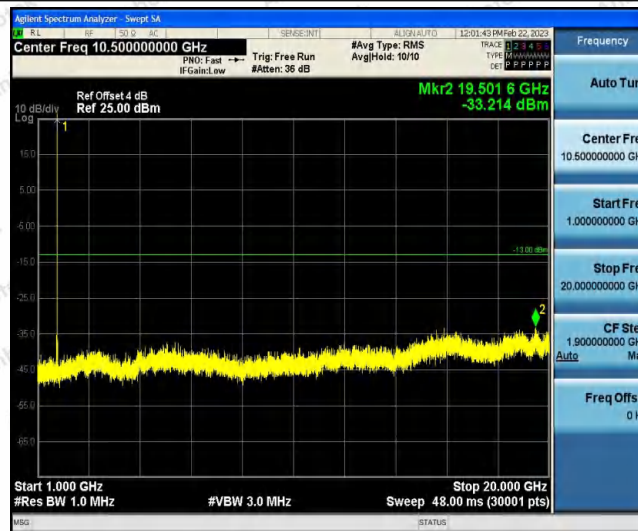

Band4-15MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

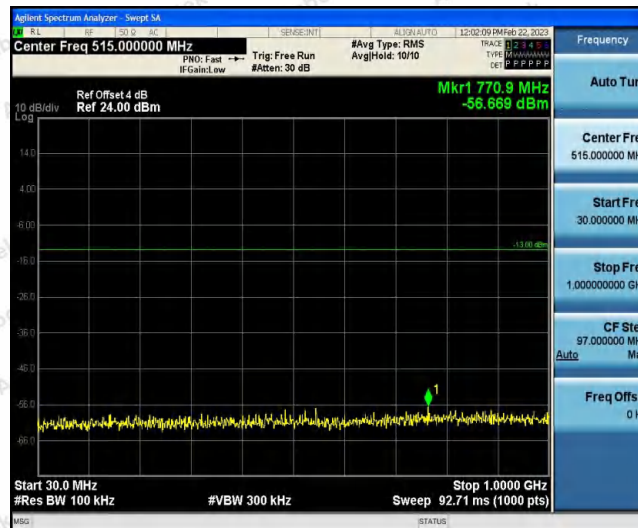

Band4-15MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

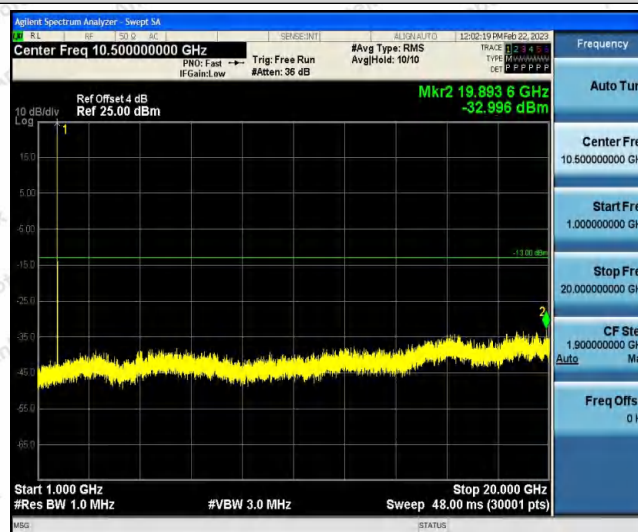

Band4-15MHz-16QAM-20325-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




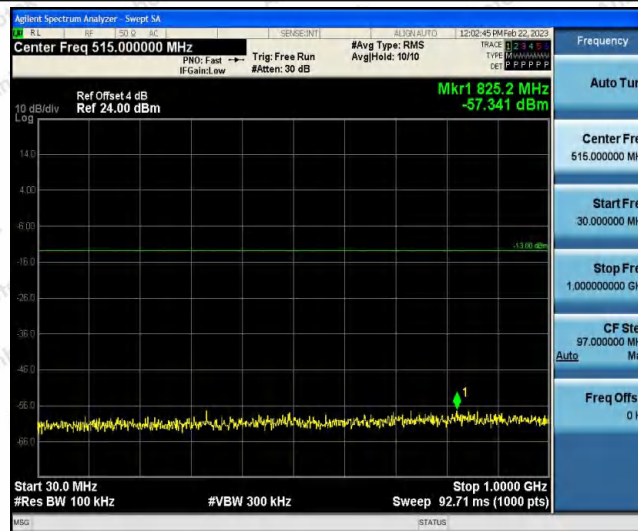

Band4-15MHz-16QAM-20325-1RB#0-Range2:1000~20000MHz

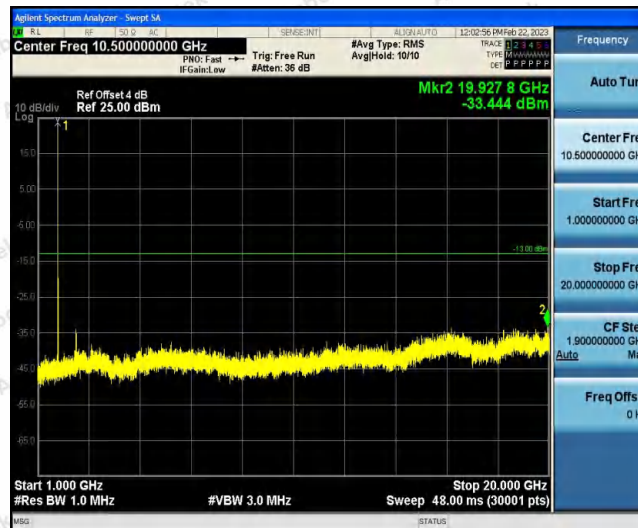

Band4-20MHz-QPSK-20050-1RB#0-Range1:30~1000MHz

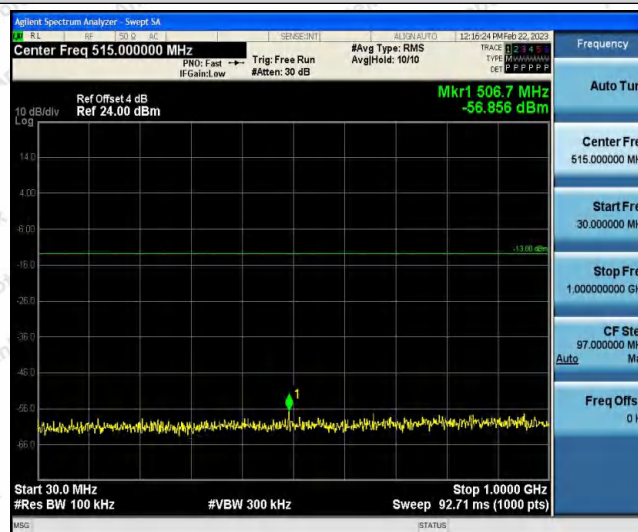

Band4-20MHz-QPSK-20050-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




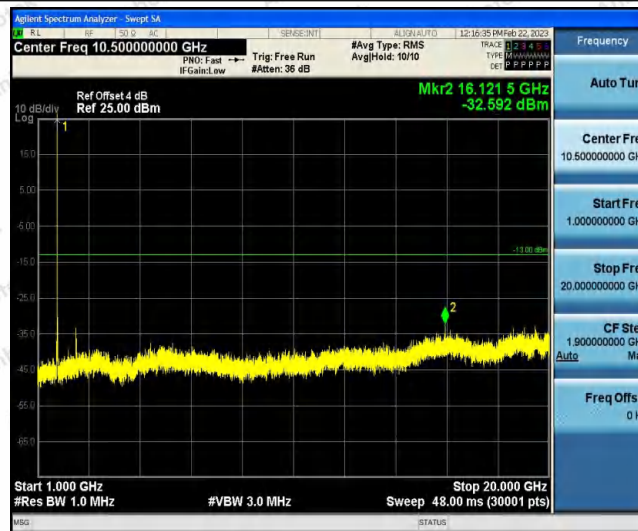

Band4-20MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

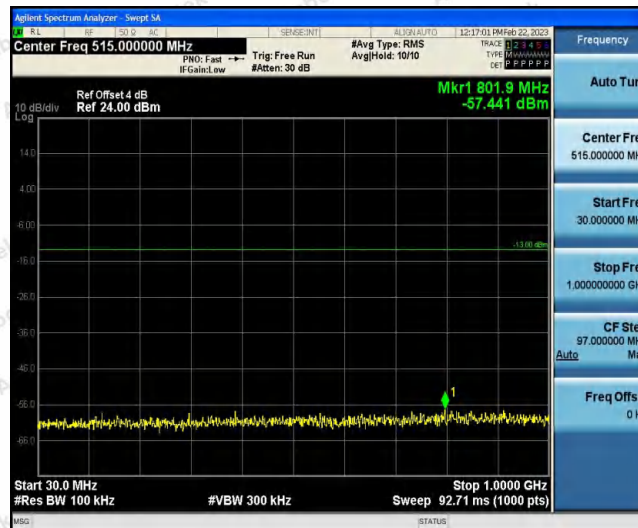

Band4-20MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

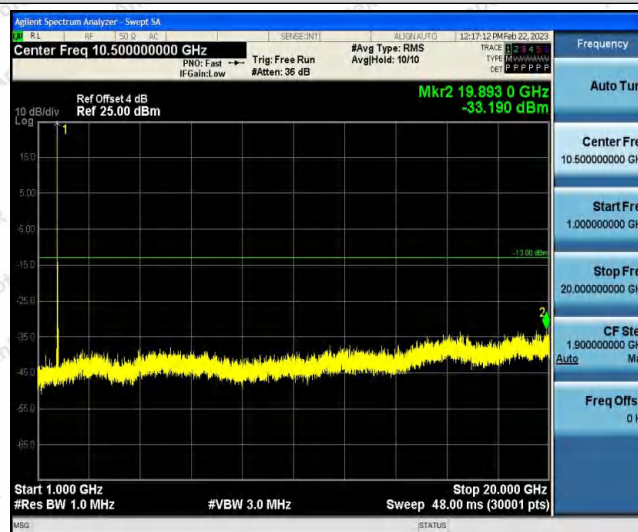

Band4-20MHz-QPSK-20300-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




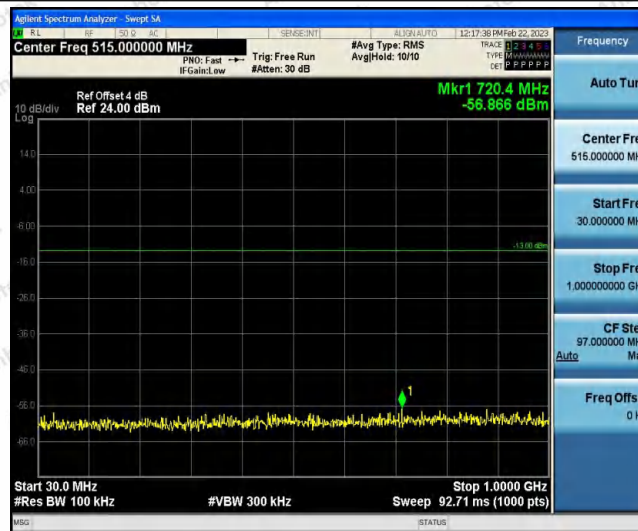

Band4-20MHz-QPSK-20300-1RB#0-Range2:1000~20000MHz



Band4-20MHz-16QAM-20050-1RB#0-Range1:30~1000MHz

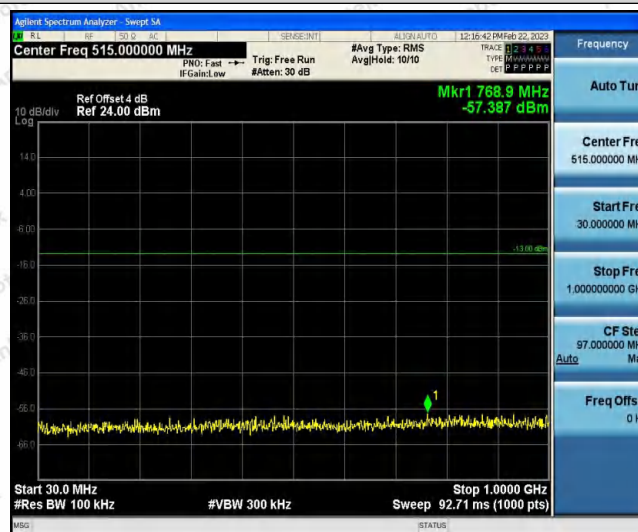

Band4-20MHz-16QAM-20050-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




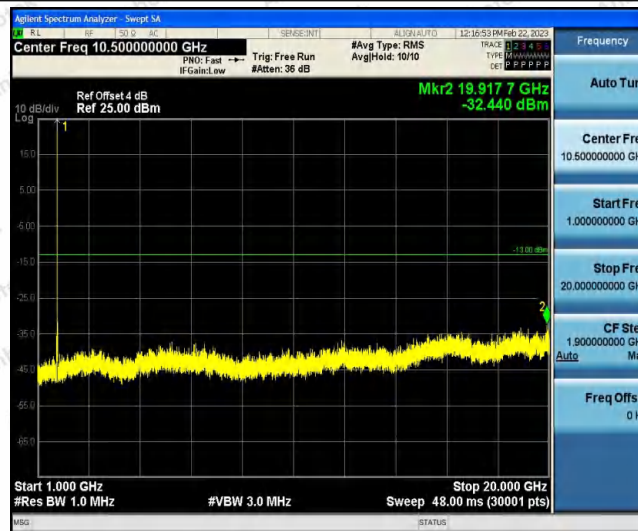

Band4-20MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

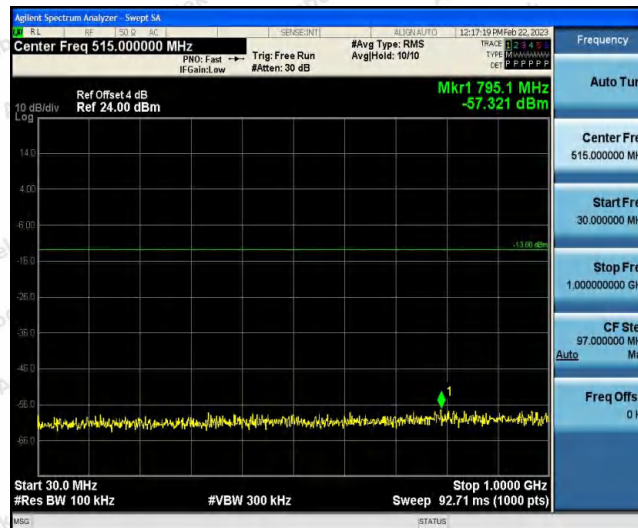

Band4-20MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

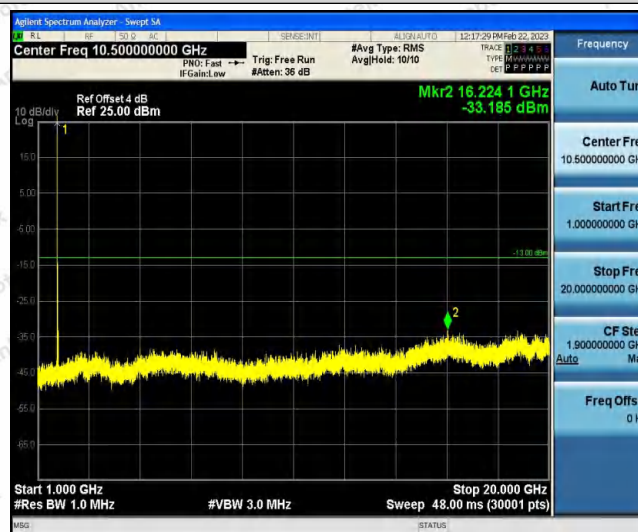

Band4-20MHz-16QAM-20300-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



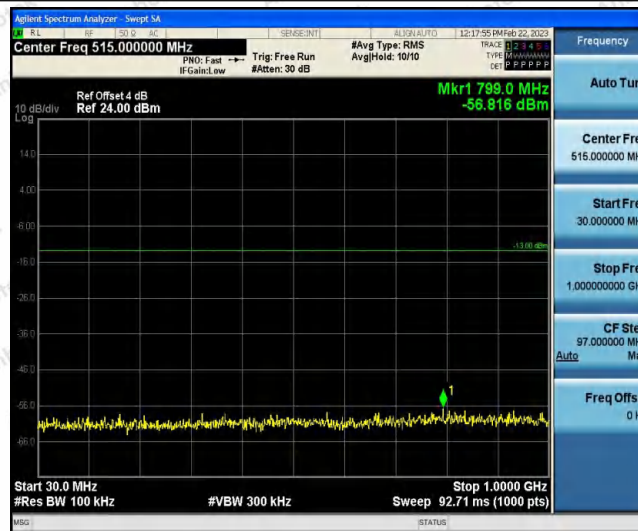

Band4-20MHz-16QAM-20300-1RB#0-Range2:1000~20000MHz

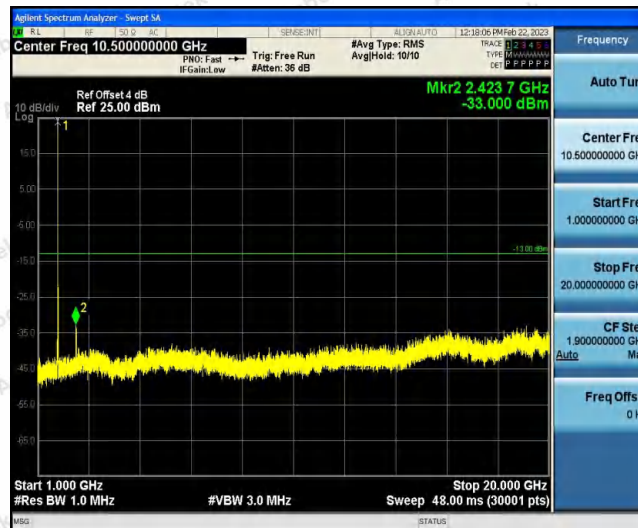

Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band4	1.4MHz	QPSK	19957	6RB#0	VL	NT	6.14	0.003589	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VN	NT	-3.82	-0.002233	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VH	NT	3.93	0.002297	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VL	NT	5.38	0.003105	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VN	NT	4.48	0.002586	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VH	NT	4.12	0.002378	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VL	NT	-8.17	-0.004657	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VN	NT	-5.01	-0.002856	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VH	NT	-6.44	-0.003671	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VL	NT	4.38	0.002560	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VN	NT	-3.19	-0.001865	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VH	NT	-4.45	-0.002601	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VL	NT	-5.31	-0.003065	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VN	NT	3.45	0.001991	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VH	NT	4.69	0.002707	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VL	NT	-6.94	-0.003956	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VN	NT	-7.60	-0.004332	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VH	NT	-6.54	-0.003728	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VL	NT	-3.78	-0.002209	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VN	NT	2.42	0.001414	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VH	NT	3.42	0.001998	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VL	NT	-7.32	-0.004225	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VN	NT	-2.09	-0.001206	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VH	NT	-2.95	-0.001703	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VL	NT	2.62	0.001494	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VN	NT	-2.70	-0.001540	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VH	NT	3.95	0.002253	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VL	NT	5.78	0.003377	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VN	NT	-2.60	-0.001519	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VH	NT	-2.70	-0.001578	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VL	NT	-2.46	-0.001420	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VN	NT	-3.18	-0.001835	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VH	NT	2.89	0.001668	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VL	NT	2.99	0.001705	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band4	3MHz	16QAM	20385	15RB#0	VN	NT	4.78	0.002726	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VH	NT	3.86	0.002201	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VL	NT	5.75	0.003358	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VN	NT	4.06	0.002371	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VH	NT	3.73	0.002178	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VL	NT	6.19	0.003573	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VN	NT	2.56	0.001478	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VH	NT	5.41	0.003123	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VL	NT	-6.47	-0.003692	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VN	NT	-2.25	-0.001284	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VH	NT	-5.26	-0.003001	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VL	NT	7.27	0.004245	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VN	NT	5.92	0.003457	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VH	NT	4.49	0.002622	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VL	NT	-3.48	-0.002009	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VN	NT	-3.03	-0.001749	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VH	NT	3.18	0.001835	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VL	NT	-5.71	-0.003258	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VN	NT	-6.32	-0.003606	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VH	NT	-4.59	-0.002619	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VL	NT	-5.38	-0.003137	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VN	NT	-5.31	-0.003096	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VH	NT	-4.55	-0.002653	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VL	NT	-2.85	-0.001645	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VN	NT	3.56	0.002055	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VH	NT	2.16	0.001247	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VL	NT	5.68	0.003246	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VN	NT	7.20	0.004114	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VH	NT	5.44	0.003109	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VL	NT	-4.96	-0.002892	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VN	NT	-6.19	-0.003609	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VH	NT	-4.99	-0.002910	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VL	NT	3.72	0.002147	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VN	NT	-2.98	-0.001720	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VH	NT	3.00	0.001732	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VL	NT	3.26	0.001863	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VN	NT	3.25	0.001857	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VH	NT	2.32	0.001326	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VL	NT	-3.55	-0.002067	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VN	NT	4.26	0.002480	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VH	NT	3.69	0.002148	±2.5	PASS



Band4	15MHz	QPSK	20175	75RB#0	VL	NT	-3.99	-0.002303	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VN	NT	3.50	0.002020	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VH	NT	5.49	0.003169	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VL	NT	1.85	0.001059	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VN	NT	3.12	0.001785	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VH	NT	3.46	0.001980	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VL	NT	4.92	0.002865	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VN	NT	3.53	0.002055	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VH	NT	5.36	0.003121	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VL	NT	-3.30	-0.001905	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VN	NT	-3.20	-0.001847	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VH	NT	-3.52	-0.002032	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VL	NT	-4.79	-0.002741	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VN	NT	3.46	0.001980	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VH	NT	2.76	0.001579	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VL	NT	5.35	0.003110	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VN	NT	5.98	0.003477	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VH	NT	7.40	0.004302	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VL	NT	3.23	0.001864	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VN	NT	-4.58	-0.002644	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VH	NT	-4.13	-0.002384	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VL	NT	-8.11	-0.004648	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VN	NT	-5.19	-0.002974	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VH	NT	-5.72	-0.003278	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VL	NT	4.31	0.002506	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VN	NT	5.19	0.003017	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VH	NT	3.10	0.001802	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VL	NT	5.69	0.003284	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VN	NT	3.45	0.001991	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VH	NT	-3.96	-0.002286	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VL	NT	-7.77	-0.004453	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VN	NT	-7.85	-0.004499	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VH	NT	-5.45	-0.003123	±2.5	PASS



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-30	5.98	0.003496	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-20	6.38	0.003729	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	0	5.35	0.003127	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	10	-3.53	-0.002063	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	20	4.86	0.002841	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-30	2.89	0.001668	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-20	-4.35	-0.002511	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	0	-3.35	-0.001934	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	10	5.11	0.002949	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	20	-3.53	-0.002038	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-30	-6.31	-0.003597	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-20	-8.54	-0.004868	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	0	-5.05	-0.002879	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	10	-7.95	-0.004532	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	20	-6.58	-0.003751	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-30	3.33	0.001947	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-20	4.29	0.002508	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	0	3.06	0.001789	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	10	6.18	0.003613	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	20	4.82	0.002818	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-30	5.56	0.003209	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-20	3.98	0.002297	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	0	4.11	0.002372	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	10	-4.03	-0.002326	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	20	-4.46	-0.002574	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-30	-4.95	-0.002822	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-20	-6.22	-0.003546	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	0	-4.89	-0.002787	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	10	-6.05	-0.003449	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	20	-3.22	-0.001835	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-30	3.32	0.001940	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-20	2.56	0.001496	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	0	-3.62	-0.002115	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	10	3.20	0.001870	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	20	-2.80	-0.001636	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band4	3MHz	QPSK	20175	15RB#0	NV	-30	5.52	0.003186	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-20	3.79	0.002188	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	0	4.79	0.002765	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	10	6.12	0.003532	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	20	-2.68	-0.001547	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-30	2.82	0.001608	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-20	3.68	0.002099	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	0	3.85	0.002196	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	10	3.68	0.002099	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	20	3.45	0.001967	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-30	-5.25	-0.003067	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-20	4.71	0.002752	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	0	2.49	0.001455	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	10	3.55	0.002074	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	20	-4.21	-0.002460	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-30	4.09	0.002361	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-20	4.52	0.002609	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	0	5.45	0.003146	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	10	3.40	0.001962	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	20	4.73	0.002730	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-30	-4.81	-0.002743	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-20	-5.92	-0.003376	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	0	3.42	0.001950	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	10	3.63	0.002070	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	20	-6.21	-0.003541	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-30	2.63	0.001536	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-20	3.39	0.001980	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	0	4.38	0.002558	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	10	-5.12	-0.002990	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	20	-3.39	-0.001980	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-30	-4.69	-0.002707	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-20	4.33	0.002499	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	0	-2.83	-0.001633	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	10	4.51	0.002603	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	20	3.12	0.001801	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-30	-5.36	-0.003058	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-20	-4.91	-0.002802	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	0	-6.62	-0.003777	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	10	-6.45	-0.003680	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	20	-6.57	-0.003749	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-30	3.62	0.002114	±2.5	PASS



Band4	5MHz	16QAM	19975	25RB#0	NV	-20	4.22	0.002464	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	0	4.32	0.002523	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	10	3.79	0.002213	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	20	4.81	0.002809	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-30	2.92	0.001685	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-20	-3.56	-0.002055	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	0	-2.06	-0.001189	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	10	4.69	0.002707	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	20	5.06	0.002921	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-30	-5.29	-0.003019	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-20	-5.46	-0.003116	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	0	-5.12	-0.002922	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	10	-4.08	-0.002328	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	20	-6.48	-0.003698	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-30	-4.66	-0.002717	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-20	-4.98	-0.002904	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	0	-3.93	-0.002292	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	10	-4.65	-0.002711	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	20	-5.82	-0.003394	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-30	2.60	0.001501	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-20	2.59	0.001495	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	0	3.09	0.001784	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	10	-3.26	-0.001882	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	20	-2.78	-0.001605	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-30	6.59	0.003766	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-20	6.21	0.003549	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	0	5.84	0.003337	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	10	5.01	0.002863	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	20	4.16	0.002377	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-30	-5.51	-0.003213	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-20	-6.44	-0.003755	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	0	-6.17	-0.003598	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	10	-5.76	-0.003359	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	20	-5.05	-0.002945	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-30	4.01	0.002315	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-20	1.93	0.001114	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	0	4.23	0.002442	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	10	4.38	0.002528	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	20	-3.55	-0.002049	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-30	3.59	0.002051	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-20	6.25	0.003571	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band4	10MHz	16QAM	20350	50RB#0	NV	0	5.69	0.003251	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	10	3.76	0.002149	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	20	3.03	0.001731	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-30	-2.49	-0.001450	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-20	-3.65	-0.002125	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	0	-3.16	-0.001840	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	10	4.38	0.002550	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	20	3.83	0.002230	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-30	-3.58	-0.002066	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-20	-1.82	-0.001051	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	0	4.38	0.002528	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	10	-3.45	-0.001991	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	20	4.76	0.002747	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-30	2.98	0.001705	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-20	3.38	0.001934	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	0	3.95	0.002260	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	10	-2.92	-0.001671	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	20	5.25	0.003004	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-30	-2.73	-0.001590	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-20	4.06	0.002364	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	0	-2.88	-0.001677	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	10	3.36	0.001956	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	20	4.86	0.002830	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-30	-2.55	-0.001472	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-20	2.89	0.001668	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	0	-4.18	-0.002413	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	10	-2.82	-0.001628	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	20	3.09	0.001784	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-30	4.35	0.002489	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-20	-3.48	-0.001991	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	0	1.67	0.000956	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	10	3.16	0.001808	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	20	2.65	0.001516	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-30	3.99	0.002320	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-20	5.42	0.003151	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	0	-3.79	-0.002203	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	10	4.99	0.002901	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	20	5.91	0.003436	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-30	3.08	0.001778	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-20	2.90	0.001674	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	0	2.82	0.001628	±2.5	PASS



Band4	20MHz	QPSK	20175	100RB#0	NV	10	-2.86	-0.001651	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	20	2.47	0.001426	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-30	-8.08	-0.004630	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-20	-5.01	-0.002871	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	0	-6.34	-0.003633	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	10	-5.11	-0.002928	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	20	-7.52	-0.004309	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-30	8.28	0.004814	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-20	3.28	0.001907	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	0	4.25	0.002471	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	10	4.95	0.002878	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	20	4.91	0.002855	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-30	3.66	0.002113	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-20	3.89	0.002245	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	0	5.04	0.002909	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	10	1.56	0.000900	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	20	2.36	0.001362	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-30	-3.92	-0.002246	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-20	-5.38	-0.003083	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	0	-6.12	-0.003507	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	10	-3.43	-0.001966	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	20	-7.10	-0.004069	±2.5	PASS

---END---

