




Test Graphs

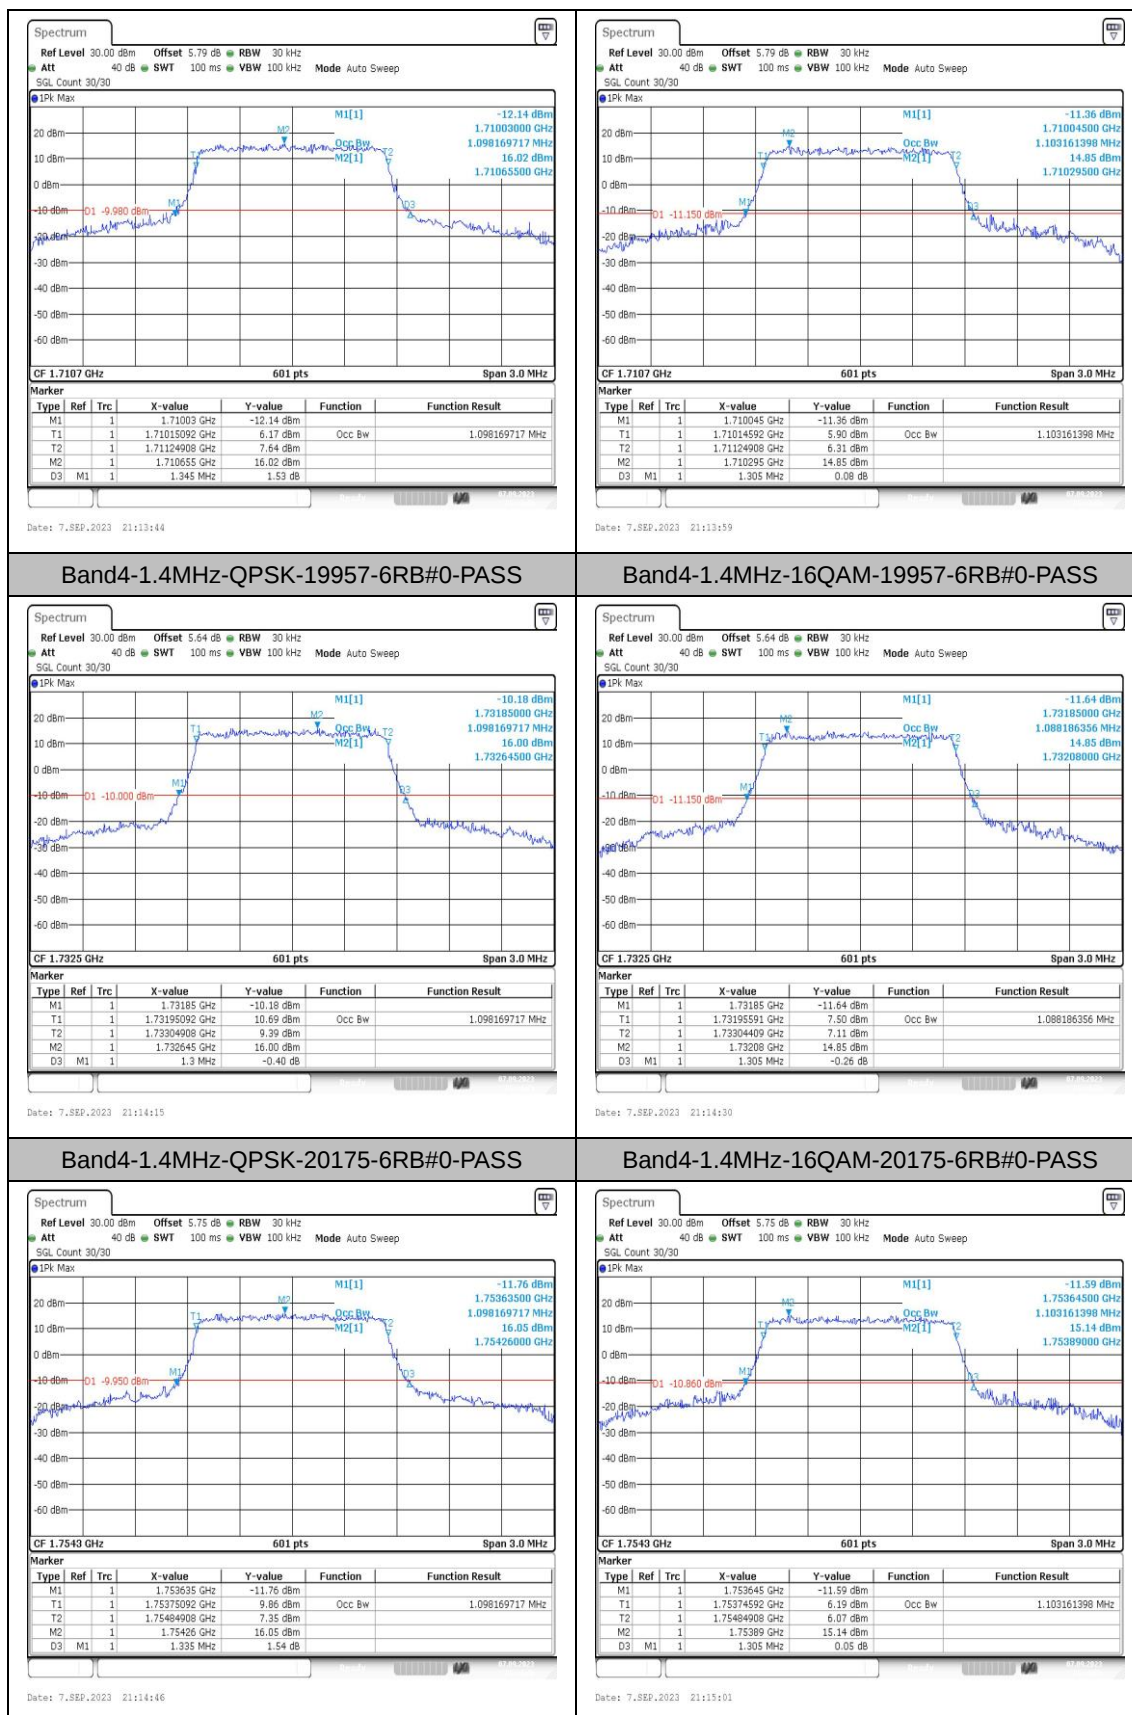



Waltek Testing Group (Shenzhen) Co., Ltd.


<http://www.waltek.com.cn>

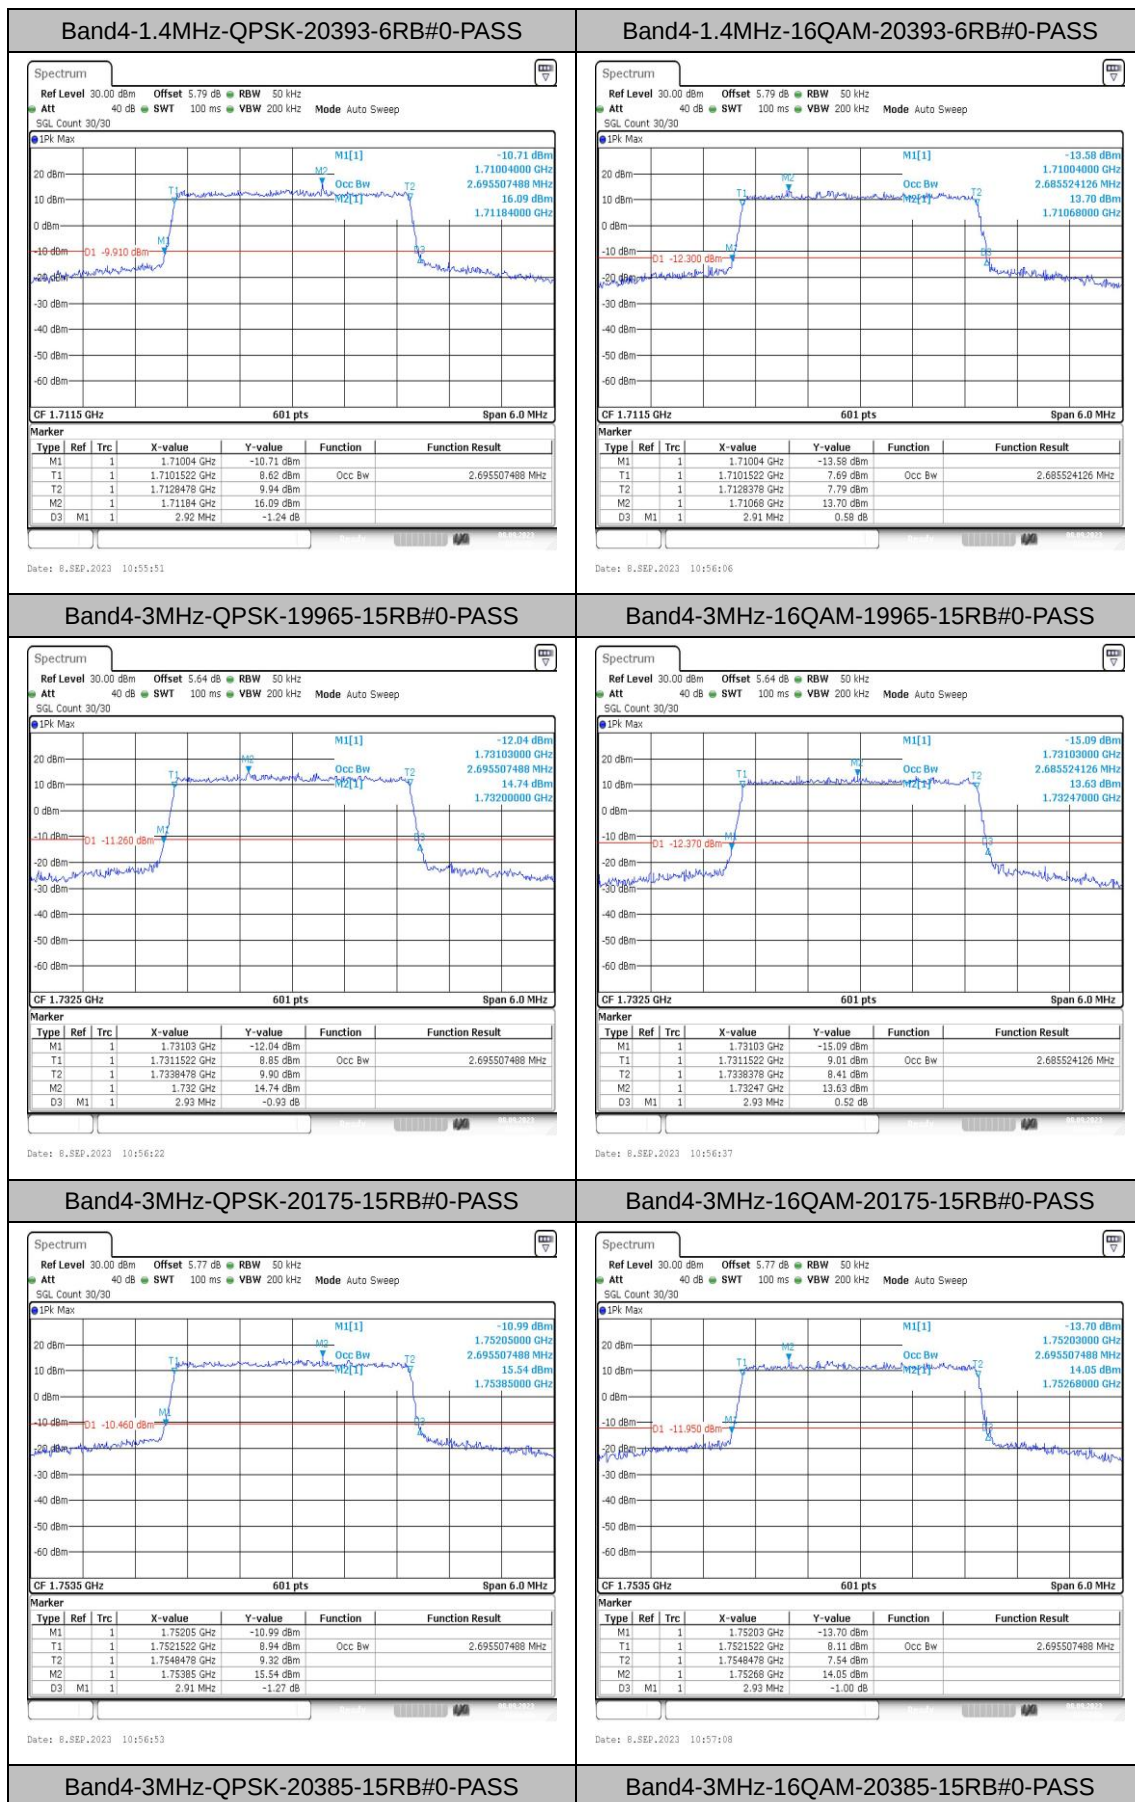

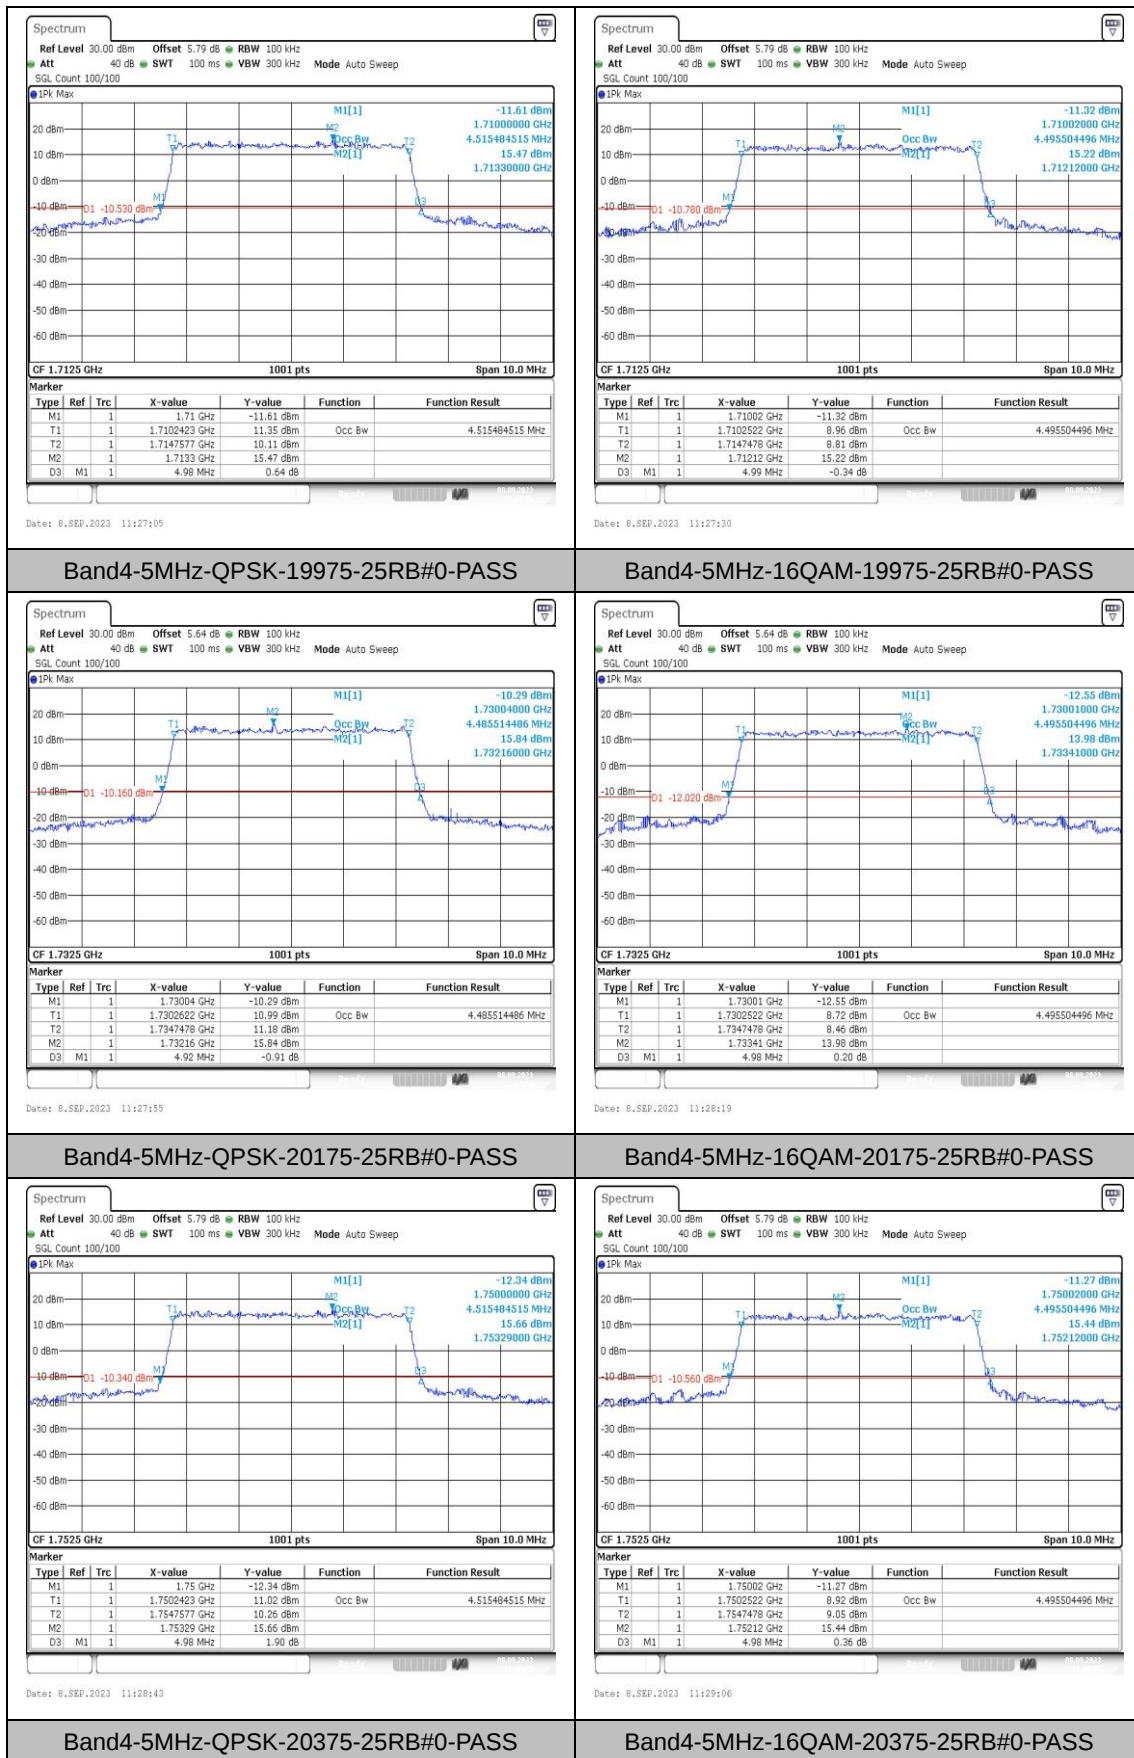

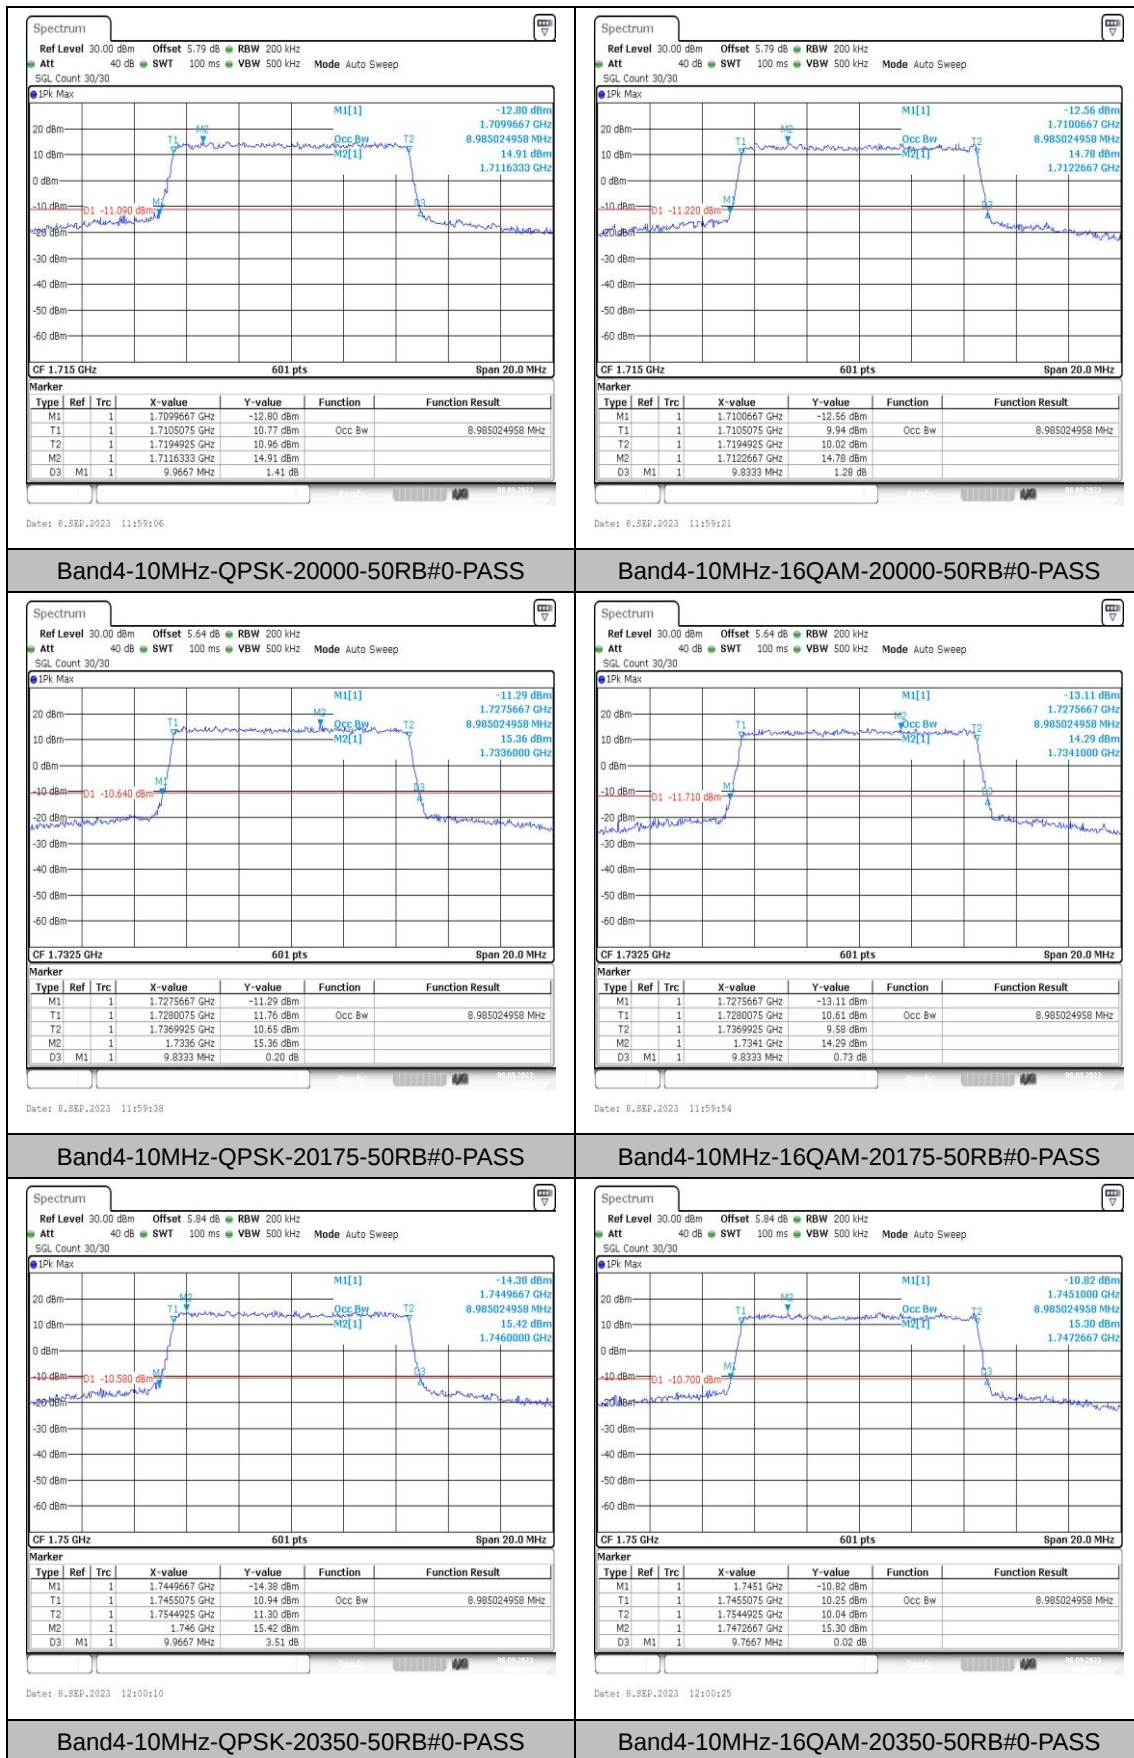

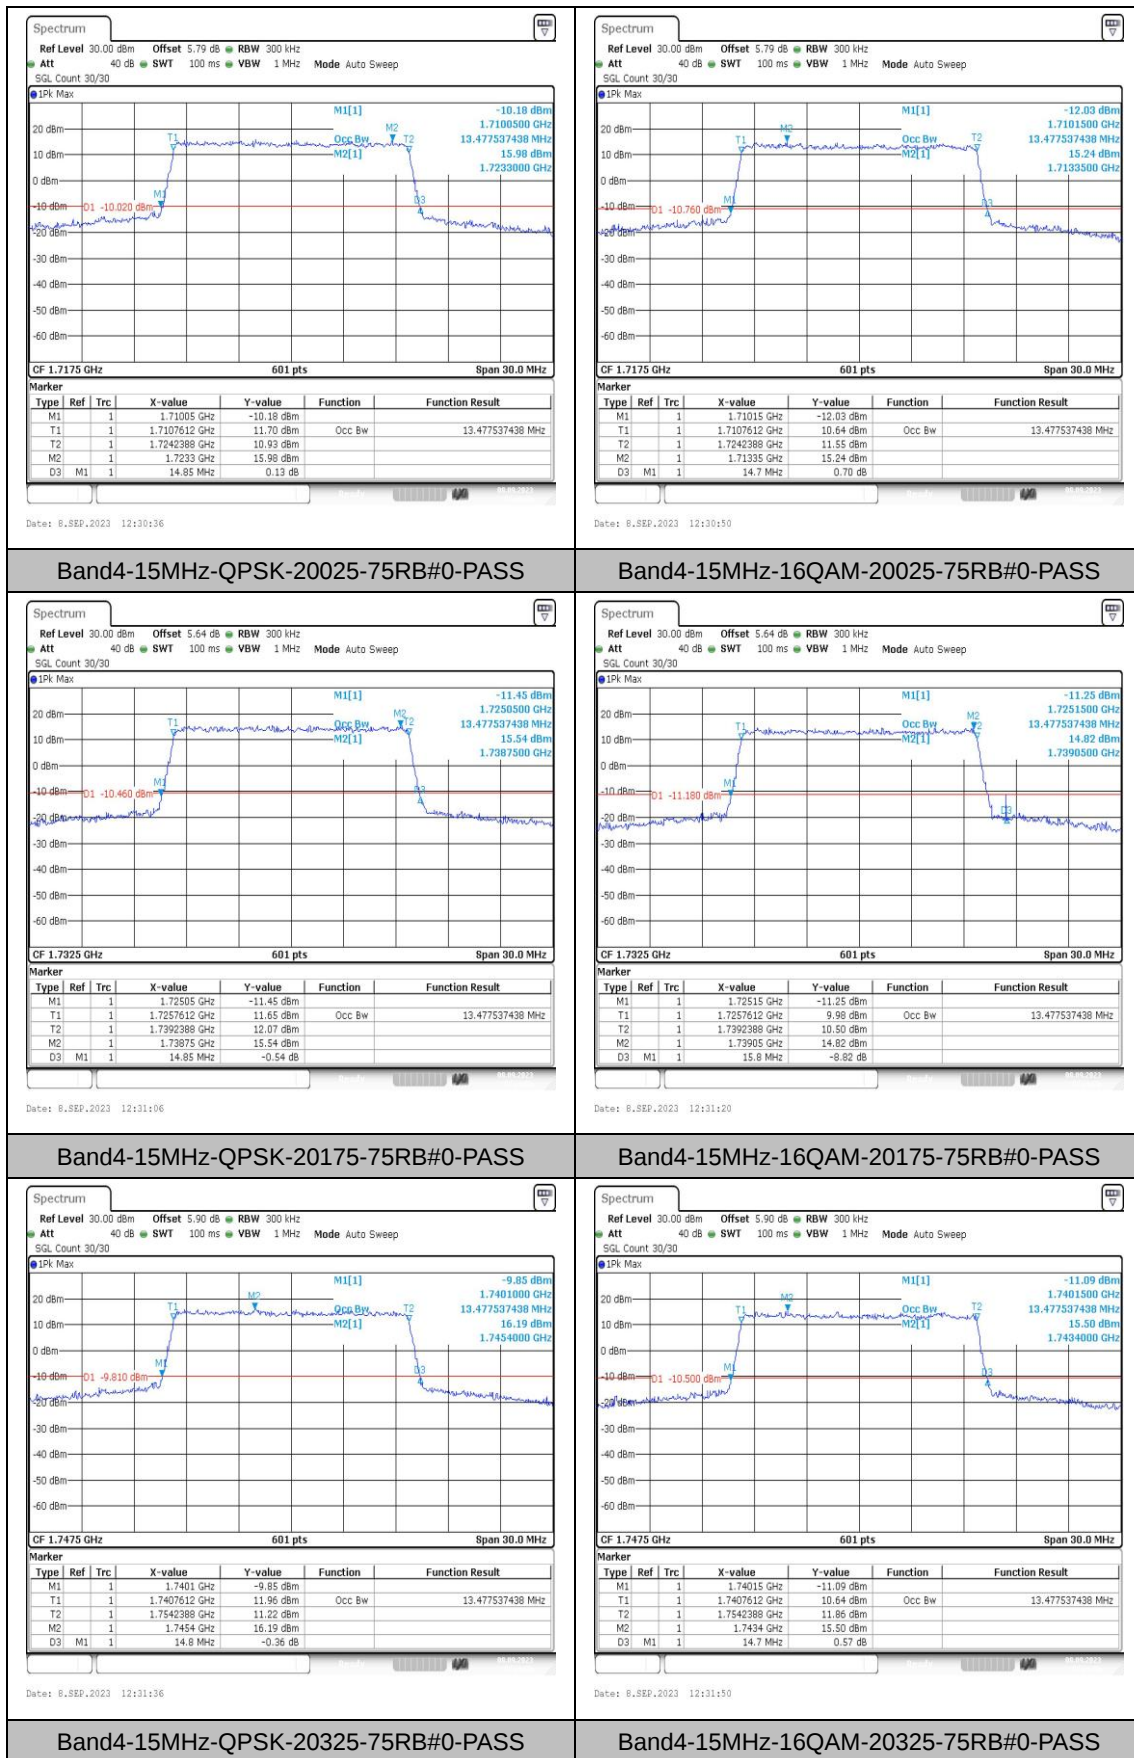

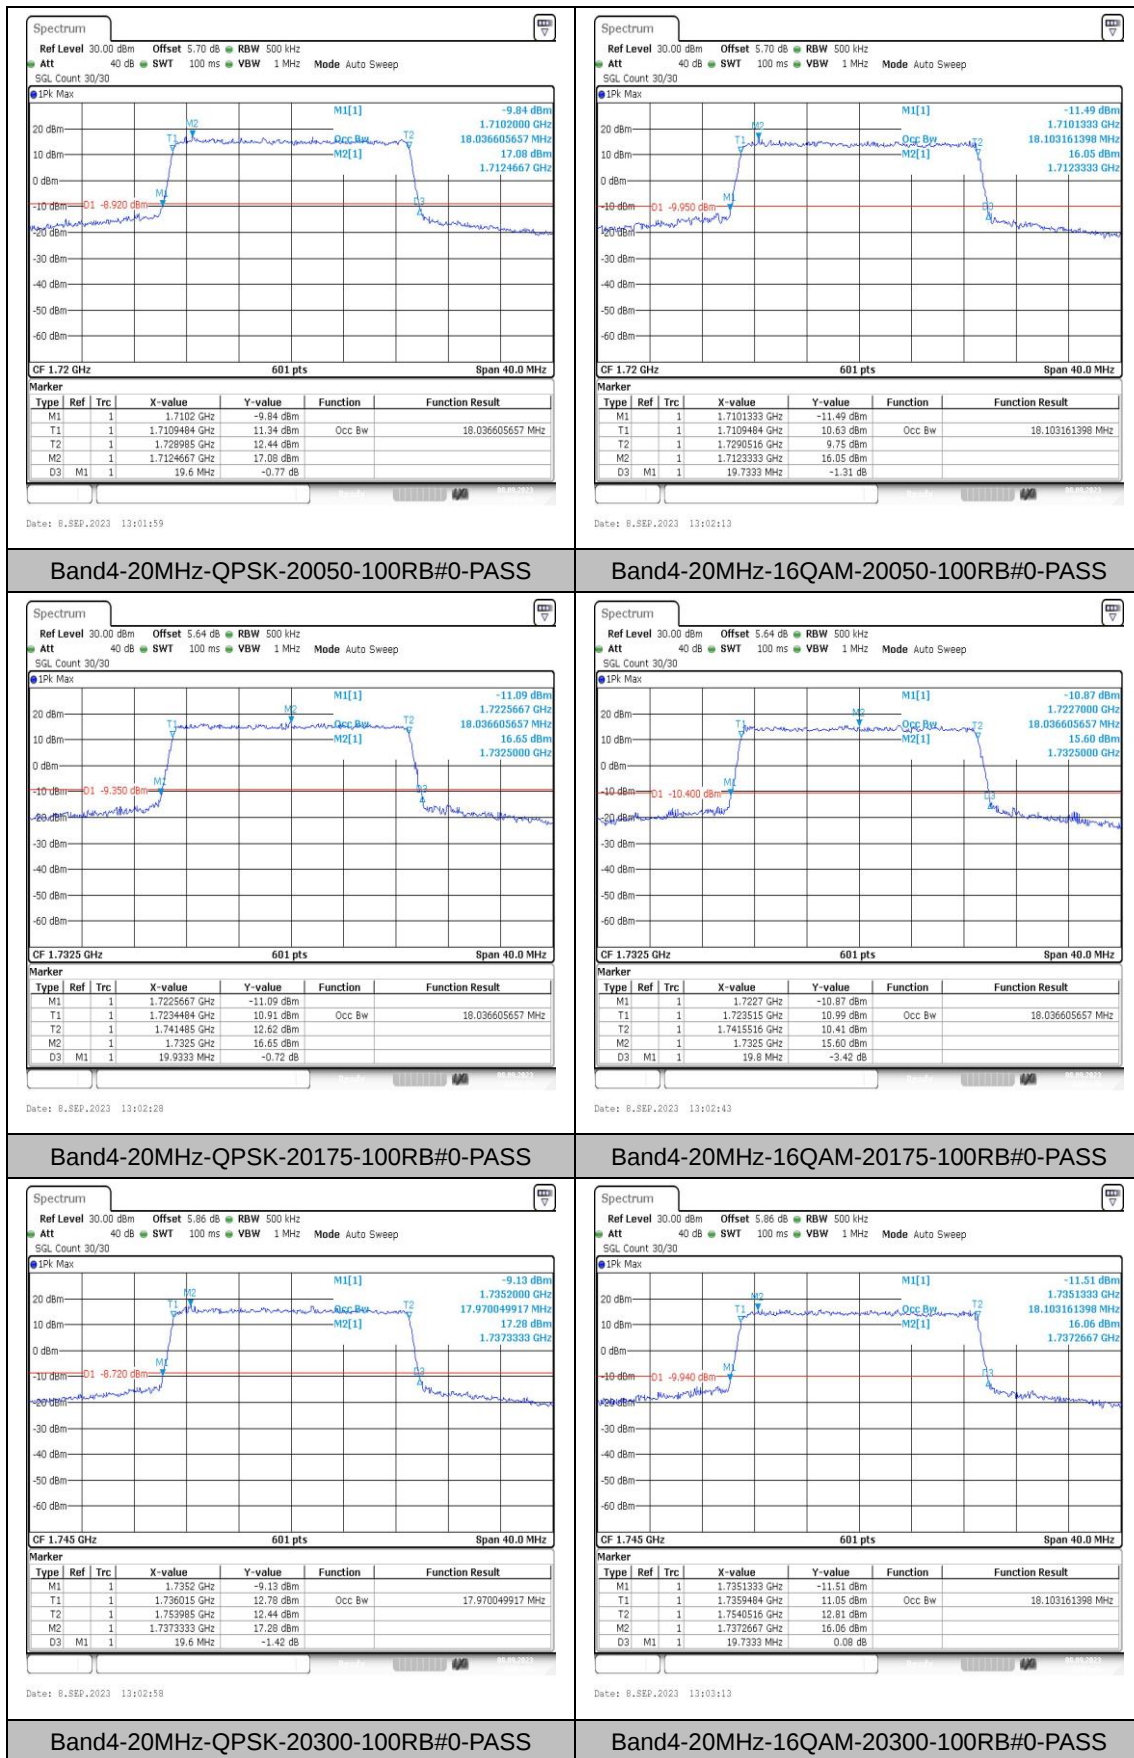


Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band4	1.4MHz	QPSK	19957	1RB#0	-21.37	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	-24.52	PASS
Band4	1.4MHz	QPSK	19957	1RB#5	-27.67	PASS
Band4	1.4MHz	16QAM	19957	1RB#5	-29.37	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	-18.84	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	-23.29	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	-28.00	PASS
Band4	1.4MHz	16QAM	20393	1RB#0	-29.54	PASS
Band4	1.4MHz	QPSK	20393	1RB#5	-22.16	PASS
Band4	1.4MHz	16QAM	20393	1RB#5	-22.50	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	-19.60	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	-23.22	PASS
Band4	3MHz	QPSK	19965	1RB#0	-18.88	PASS
Band4	3MHz	16QAM	19965	1RB#0	-20.17	PASS
Band4	3MHz	QPSK	19965	1RB#14	-26.88	PASS
Band4	3MHz	16QAM	19965	1RB#14	-28.04	PASS
Band4	3MHz	QPSK	19965	15RB#0	-14.91	PASS
Band4	3MHz	16QAM	19965	15RB#0	-17.55	PASS
Band4	3MHz	QPSK	20385	1RB#0	-27.61	PASS
Band4	3MHz	16QAM	20385	1RB#0	-26.25	PASS
Band4	3MHz	QPSK	20385	1RB#14	-19.93	PASS
Band4	3MHz	16QAM	20385	1RB#14	-19.74	PASS
Band4	3MHz	QPSK	20385	15RB#0	-16.44	PASS
Band4	3MHz	16QAM	20385	15RB#0	-18.79	PASS
Band4	5MHz	QPSK	19975	1RB#0	-20.85	PASS
Band4	5MHz	16QAM	19975	1RB#0	-21.36	PASS
Band4	5MHz	QPSK	19975	1RB#24	-35.11	PASS
Band4	5MHz	16QAM	19975	1RB#24	-39.09	PASS
Band4	5MHz	QPSK	19975	25RB#0	-16.13	PASS
Band4	5MHz	16QAM	19975	25RB#0	-18.56	PASS
Band4	5MHz	QPSK	20375	1RB#0	-40.18	PASS
Band4	5MHz	16QAM	20375	1RB#0	-40.28	PASS
Band4	5MHz	QPSK	20375	1RB#24	-20.50	PASS
Band4	5MHz	16QAM	20375	1RB#24	-21.29	PASS
Band4	5MHz	QPSK	20375	25RB#0	-17.30	PASS
Band4	5MHz	16QAM	20375	25RB#0	-19.93	PASS

Band4	10MHz	QPSK	20000	1RB#0	-23.38	PASS
Band4	10MHz	16QAM	20000	1RB#0	-24.53	PASS
Band4	10MHz	QPSK	20000	1RB#49	-41.13	PASS
Band4	10MHz	16QAM	20000	1RB#49	-38.28	PASS
Band4	10MHz	QPSK	20000	50RB#0	-18.70	PASS
Band4	10MHz	16QAM	20000	50RB#0	-21.26	PASS
Band4	10MHz	QPSK	20350	1RB#0	-41.61	PASS
Band4	10MHz	16QAM	20350	1RB#0	-41.47	PASS
Band4	10MHz	QPSK	20350	1RB#49	-22.51	PASS
Band4	10MHz	16QAM	20350	1RB#49	-22.57	PASS
Band4	10MHz	QPSK	20350	50RB#0	-19.95	PASS
Band4	10MHz	16QAM	20350	50RB#0	-22.52	PASS
Band4	15MHz	QPSK	20025	1RB#0	-24.25	PASS
Band4	15MHz	16QAM	20025	1RB#0	-24.80	PASS
Band4	15MHz	QPSK	20025	1RB#74	-41.73	PASS
Band4	15MHz	16QAM	20025	1RB#74	-41.71	PASS
Band4	15MHz	QPSK	20025	75RB#0	-18.21	PASS
Band4	15MHz	16QAM	20025	75RB#0	-21.74	PASS
Band4	15MHz	QPSK	20325	1RB#0	-41.06	PASS
Band4	15MHz	16QAM	20325	1RB#0	-42.25	PASS
Band4	15MHz	QPSK	20325	1RB#74	-24.26	PASS
Band4	15MHz	16QAM	20325	1RB#74	-25.12	PASS
Band4	15MHz	QPSK	20325	75RB#0	-19.86	PASS
Band4	15MHz	16QAM	20325	75RB#0	-23.37	PASS
Band4	20MHz	QPSK	20050	1RB#0	-26.31	PASS
Band4	20MHz	16QAM	20050	1RB#0	-27.27	PASS
Band4	20MHz	QPSK	20050	1RB#99	-42.15	PASS
Band4	20MHz	16QAM	20050	1RB#99	-42.20	PASS
Band4	20MHz	QPSK	20050	100RB#0	-22.70	PASS
Band4	20MHz	16QAM	20050	100RB#0	-25.17	PASS
Band4	20MHz	QPSK	20300	1RB#0	-42.78	PASS
Band4	20MHz	16QAM	20300	1RB#0	-42.73	PASS
Band4	20MHz	QPSK	20300	1RB#99	-25.86	PASS
Band4	20MHz	16QAM	20300	1RB#99	-26.19	PASS
Band4	20MHz	QPSK	20300	100RB#0	-24.31	PASS
Band4	20MHz	16QAM	20300	100RB#0	-26.45	PASS

Test Graphs

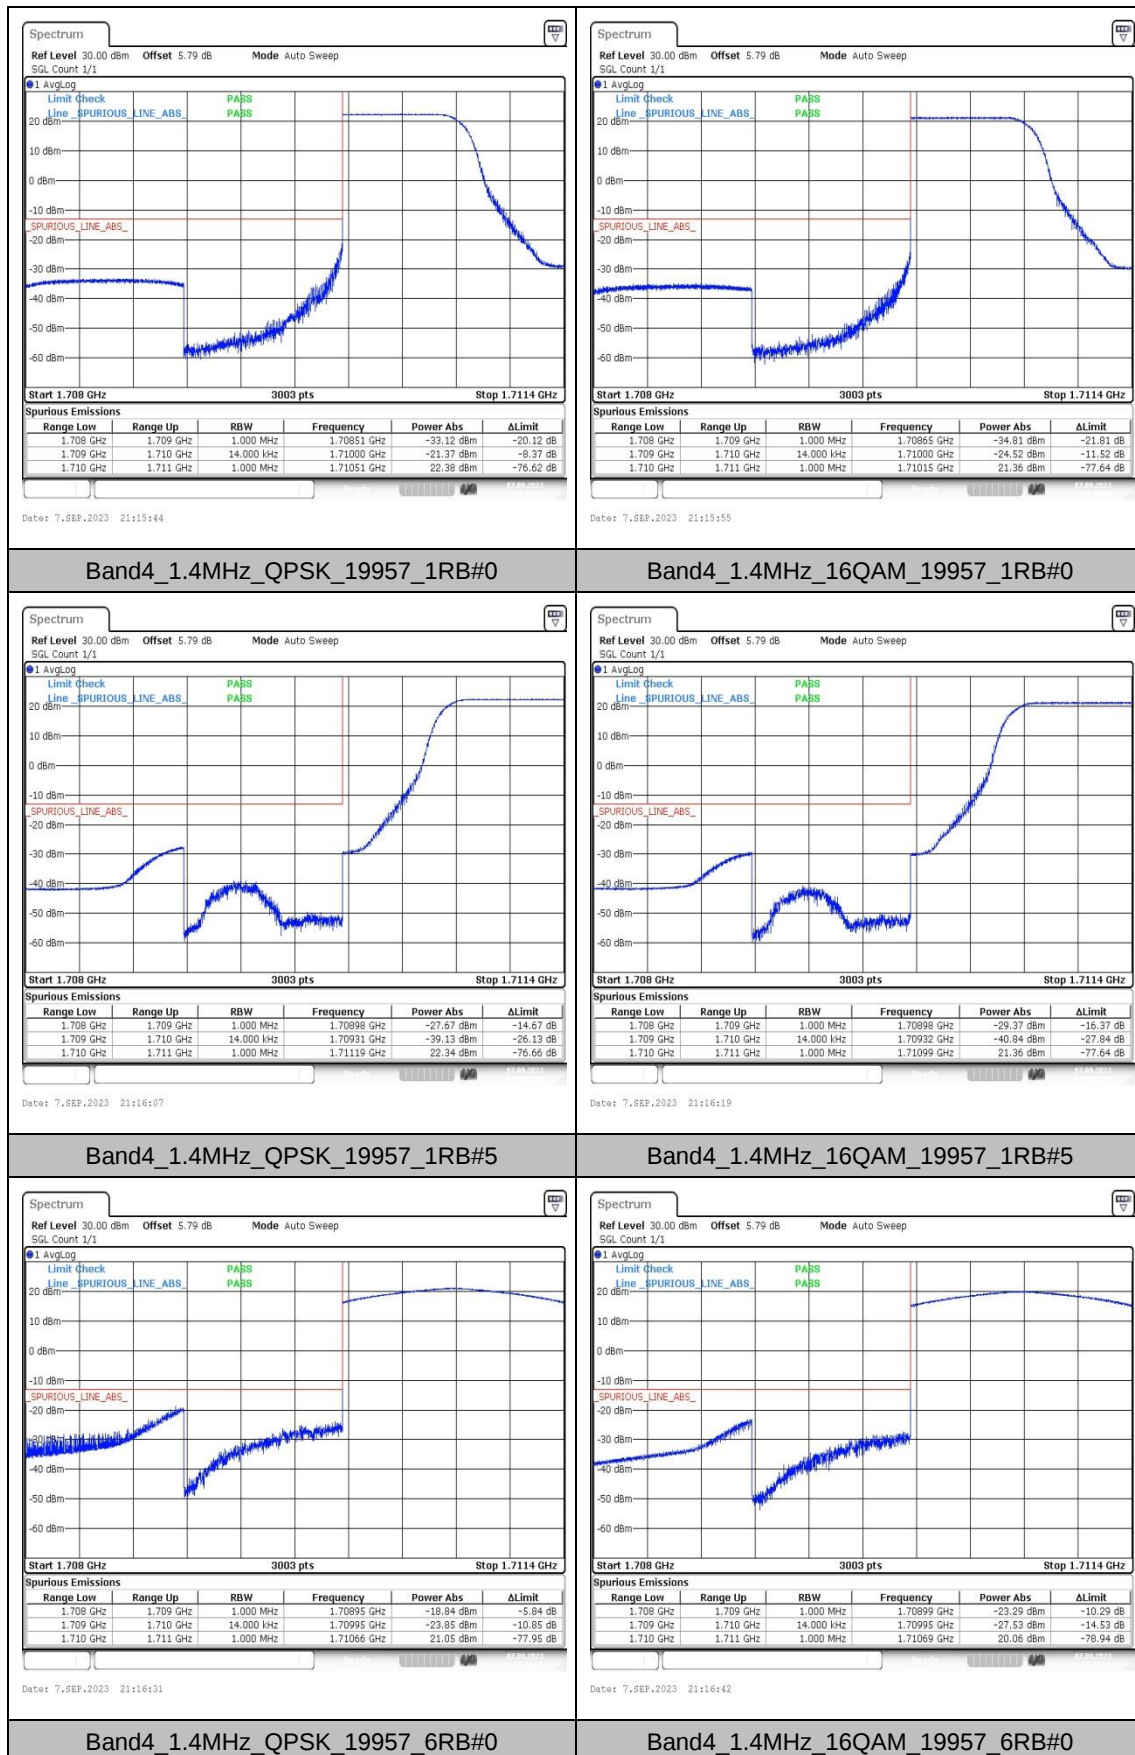

Waltek Testing Group (Shenzhen) Co., Ltd.

<http://www.waltek.com.cn>

