

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band12	1.4MHz	QPSK	23017	1RB#0	0.009~0.15	-62.94	PASS
Band12	1.4MHz	QPSK	23017	1RB#0	0.15~30	-59.37	PASS
Band12	1.4MHz	QPSK	23017	1RB#0	30~1000	-52.44	PASS
Band12	1.4MHz	QPSK	23017	1RB#0	1000~3000	-38.52	PASS
Band12	1.4MHz	QPSK	23017	1RB#0	3000~10000	-52.85	PASS
Band12	1.4MHz	16QAM	23017	1RB#0	0.009~0.15	-62.48	PASS
Band12	1.4MHz	16QAM	23017	1RB#0	0.15~30	-62.30	PASS
Band12	1.4MHz	16QAM	23017	1RB#0	30~1000	-52.90	PASS
Band12	1.4MHz	16QAM	23017	1RB#0	1000~3000	-40.23	PASS
Band12	1.4MHz	16QAM	23017	1RB#0	3000~10000	-52.54	PASS
Band12	1.4MHz	QPSK	23095	1RB#0	0.009~0.15	-60.41	PASS
Band12	1.4MHz	QPSK	23095	1RB#0	0.15~30	-62.62	PASS
Band12	1.4MHz	QPSK	23095	1RB#0	30~1000	-52.70	PASS
Band12	1.4MHz	QPSK	23095	1RB#0	1000~3000	-37.77	PASS
Band12	1.4MHz	QPSK	23095	1RB#0	3000~10000	-52.81	PASS
Band12	1.4MHz	16QAM	23095	1RB#0	0.009~0.15	-61.21	PASS
Band12	1.4MHz	16QAM	23095	1RB#0	0.15~30	-61.38	PASS
Band12	1.4MHz	16QAM	23095	1RB#0	30~1000	-53.87	PASS
Band12	1.4MHz	16QAM	23095	1RB#0	1000~3000	-39.84	PASS
Band12	1.4MHz	16QAM	23095	1RB#0	3000~10000	-52.42	PASS
Band12	1.4MHz	QPSK	23173	1RB#0	0.009~0.15	-62.65	PASS
Band12	1.4MHz	QPSK	23173	1RB#0	0.15~30	-62.49	PASS
Band12	1.4MHz	QPSK	23173	1RB#0	30~1000	-54.25	PASS
Band12	1.4MHz	QPSK	23173	1RB#0	1000~3000	-37.90	PASS
Band12	1.4MHz	QPSK	23173	1RB#0	3000~10000	-52.65	PASS
Band12	1.4MHz	16QAM	23173	1RB#0	0.009~0.15	-62.28	PASS
Band12	1.4MHz	16QAM	23173	1RB#0	0.15~30	-63.41	PASS
Band12	1.4MHz	16QAM	23173	1RB#0	30~1000	-54.11	PASS
Band12	1.4MHz	16QAM	23173	1RB#0	1000~3000	-38.41	PASS
Band12	1.4MHz	16QAM	23173	1RB#0	3000~10000	-52.77	PASS
Band12	3MHz	QPSK	23025	1RB#0	0.009~0.15	-60.89	PASS
Band12	3MHz	QPSK	23025	1RB#0	0.15~30	-61.70	PASS
Band12	3MHz	QPSK	23025	1RB#0	30~1000	-60.45	PASS
Band12	3MHz	QPSK	23025	1RB#0	1000~3000	-39.38	PASS
Band12	3MHz	QPSK	23025	1RB#0	3000~10000	-52.53	PASS
Band12	3MHz	16QAM	23025	1RB#0	0.009~0.15	-62.30	PASS
Band12	3MHz	16QAM	23025	1RB#0	0.15~30	-61.85	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band12	3MHz	16QAM	23025	1RB#0	30~1000	-60.45	PASS
Band12	3MHz	16QAM	23025	1RB#0	1000~3000	-38.68	PASS
Band12	3MHz	16QAM	23025	1RB#0	3000~10000	-52.86	PASS
Band12	3MHz	QPSK	23095	1RB#0	0.009~0.15	-61.09	PASS
Band12	3MHz	QPSK	23095	1RB#0	0.15~30	-61.27	PASS
Band12	3MHz	QPSK	23095	1RB#0	30~1000	-62.65	PASS
Band12	3MHz	QPSK	23095	1RB#0	1000~3000	-37.82	PASS
Band12	3MHz	QPSK	23095	1RB#0	3000~10000	-52.88	PASS
Band12	3MHz	16QAM	23095	1RB#0	0.009~0.15	-62.08	PASS
Band12	3MHz	16QAM	23095	1RB#0	0.15~30	-60.85	PASS
Band12	3MHz	16QAM	23095	1RB#0	30~1000	-63.31	PASS
Band12	3MHz	16QAM	23095	1RB#0	1000~3000	-39.24	PASS
Band12	3MHz	16QAM	23095	1RB#0	3000~10000	-52.70	PASS
Band12	3MHz	QPSK	23165	1RB#0	0.009~0.15	-60.10	PASS
Band12	3MHz	QPSK	23165	1RB#0	0.15~30	-60.50	PASS
Band12	3MHz	QPSK	23165	1RB#0	30~1000	-60.83	PASS
Band12	3MHz	QPSK	23165	1RB#0	1000~3000	-37.42	PASS
Band12	3MHz	QPSK	23165	1RB#0	3000~10000	-52.86	PASS
Band12	3MHz	16QAM	23165	1RB#0	0.009~0.15	-59.85	PASS
Band12	3MHz	16QAM	23165	1RB#0	0.15~30	-63.42	PASS
Band12	3MHz	16QAM	23165	1RB#0	30~1000	-60.84	PASS
Band12	3MHz	16QAM	23165	1RB#0	1000~3000	-39.72	PASS
Band12	3MHz	16QAM	23165	1RB#0	3000~10000	-53.00	PASS
Band12	5MHz	QPSK	23035	1RB#0	0.009~0.15	-61.89	PASS
Band12	5MHz	QPSK	23035	1RB#0	0.15~30	-62.16	PASS
Band12	5MHz	QPSK	23035	1RB#0	30~1000	-66.43	PASS
Band12	5MHz	QPSK	23035	1RB#0	1000~3000	-39.00	PASS
Band12	5MHz	QPSK	23035	1RB#0	3000~10000	-52.77	PASS
Band12	5MHz	16QAM	23035	1RB#0	0.009~0.15	-62.22	PASS
Band12	5MHz	16QAM	23035	1RB#0	0.15~30	-62.11	PASS
Band12	5MHz	16QAM	23035	1RB#0	30~1000	-66.58	PASS
Band12	5MHz	16QAM	23035	1RB#0	1000~3000	-38.92	PASS
Band12	5MHz	16QAM	23035	1RB#0	3000~10000	-52.73	PASS
Band12	5MHz	QPSK	23095	1RB#0	0.009~0.15	-63.03	PASS
Band12	5MHz	QPSK	23095	1RB#0	0.15~30	-60.18	PASS
Band12	5MHz	QPSK	23095	1RB#0	30~1000	-66.21	PASS
Band12	5MHz	QPSK	23095	1RB#0	1000~3000	-38.14	PASS
Band12	5MHz	QPSK	23095	1RB#0	3000~10000	-52.33	PASS
Band12	5MHz	16QAM	23095	1RB#0	0.009~0.15	-61.95	PASS
Band12	5MHz	16QAM	23095	1RB#0	0.15~30	-62.06	PASS
Band12	5MHz	16QAM	23095	1RB#0	30~1000	-66.65	PASS
Band12	5MHz	16QAM	23095	1RB#0	1000~3000	-38.58	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500


www.anbotek.com.cn



Band12	5MHz	16QAM	23095	1RB#0	3000~10000	-52.59	PASS
Band12	5MHz	QPSK	23155	1RB#0	0.009~0.15	-60.32	PASS
Band12	5MHz	QPSK	23155	1RB#0	0.15~30	-61.72	PASS
Band12	5MHz	QPSK	23155	1RB#0	30~1000	-66.21	PASS
Band12	5MHz	QPSK	23155	1RB#0	1000~3000	-39.14	PASS
Band12	5MHz	QPSK	23155	1RB#0	3000~10000	-52.39	PASS
Band12	5MHz	16QAM	23155	1RB#0	0.009~0.15	-63.59	PASS
Band12	5MHz	16QAM	23155	1RB#0	0.15~30	-59.61	PASS
Band12	5MHz	16QAM	23155	1RB#0	30~1000	-65.94	PASS
Band12	5MHz	16QAM	23155	1RB#0	1000~3000	-41.12	PASS
Band12	5MHz	16QAM	23155	1RB#0	3000~10000	-52.86	PASS
Band12	10MHz	QPSK	23060	1RB#0	0.009~0.15	-66.01	PASS
Band12	10MHz	QPSK	23060	1RB#0	0.15~30	-66.41	PASS
Band12	10MHz	QPSK	23060	1RB#0	30~1000	-69.77	PASS
Band12	10MHz	QPSK	23060	1RB#0	1000~3000	-42.79	PASS
Band12	10MHz	QPSK	23060	1RB#0	3000~10000	-56.19	PASS
Band12	10MHz	16QAM	23060	1RB#0	0.009~0.15	-66.18	PASS
Band12	10MHz	16QAM	23060	1RB#0	0.15~30	-66.32	PASS
Band12	10MHz	16QAM	23060	1RB#0	30~1000	-70.14	PASS
Band12	10MHz	16QAM	23060	1RB#0	1000~3000	-43.48	PASS
Band12	10MHz	16QAM	23060	1RB#0	3000~10000	-56.19	PASS
Band12	10MHz	QPSK	23095	1RB#0	0.009~0.15	-67.11	PASS
Band12	10MHz	QPSK	23095	1RB#0	0.15~30	-65.34	PASS
Band12	10MHz	QPSK	23095	1RB#0	30~1000	-69.58	PASS
Band12	10MHz	QPSK	23095	1RB#0	1000~3000	-42.28	PASS
Band12	10MHz	QPSK	23095	1RB#0	3000~10000	-56.14	PASS
Band12	10MHz	16QAM	23095	1RB#0	0.009~0.15	-62.16	PASS
Band12	10MHz	16QAM	23095	1RB#0	0.15~30	-65.76	PASS
Band12	10MHz	16QAM	23095	1RB#0	30~1000	-70.04	PASS
Band12	10MHz	16QAM	23095	1RB#0	1000~3000	-43.79	PASS
Band12	10MHz	16QAM	23095	1RB#0	3000~10000	-55.96	PASS
Band12	10MHz	QPSK	23130	1RB#0	0.009~0.15	-64.06	PASS
Band12	10MHz	QPSK	23130	1RB#0	0.15~30	-65.26	PASS
Band12	10MHz	QPSK	23130	1RB#0	30~1000	-69.92	PASS
Band12	10MHz	QPSK	23130	1RB#0	1000~3000	-42.45	PASS
Band12	10MHz	QPSK	23130	1RB#0	3000~10000	-56.28	PASS
Band12	10MHz	16QAM	23130	1RB#0	0.009~0.15	-67.18	PASS
Band12	10MHz	16QAM	23130	1RB#0	0.15~30	-63.05	PASS
Band12	10MHz	16QAM	23130	1RB#0	30~1000	-70.20	PASS
Band12	10MHz	16QAM	23130	1RB#0	1000~3000	-42.76	PASS
Band12	10MHz	16QAM	23130	1RB#0	3000~10000	-55.83	PASS



Test Graphs

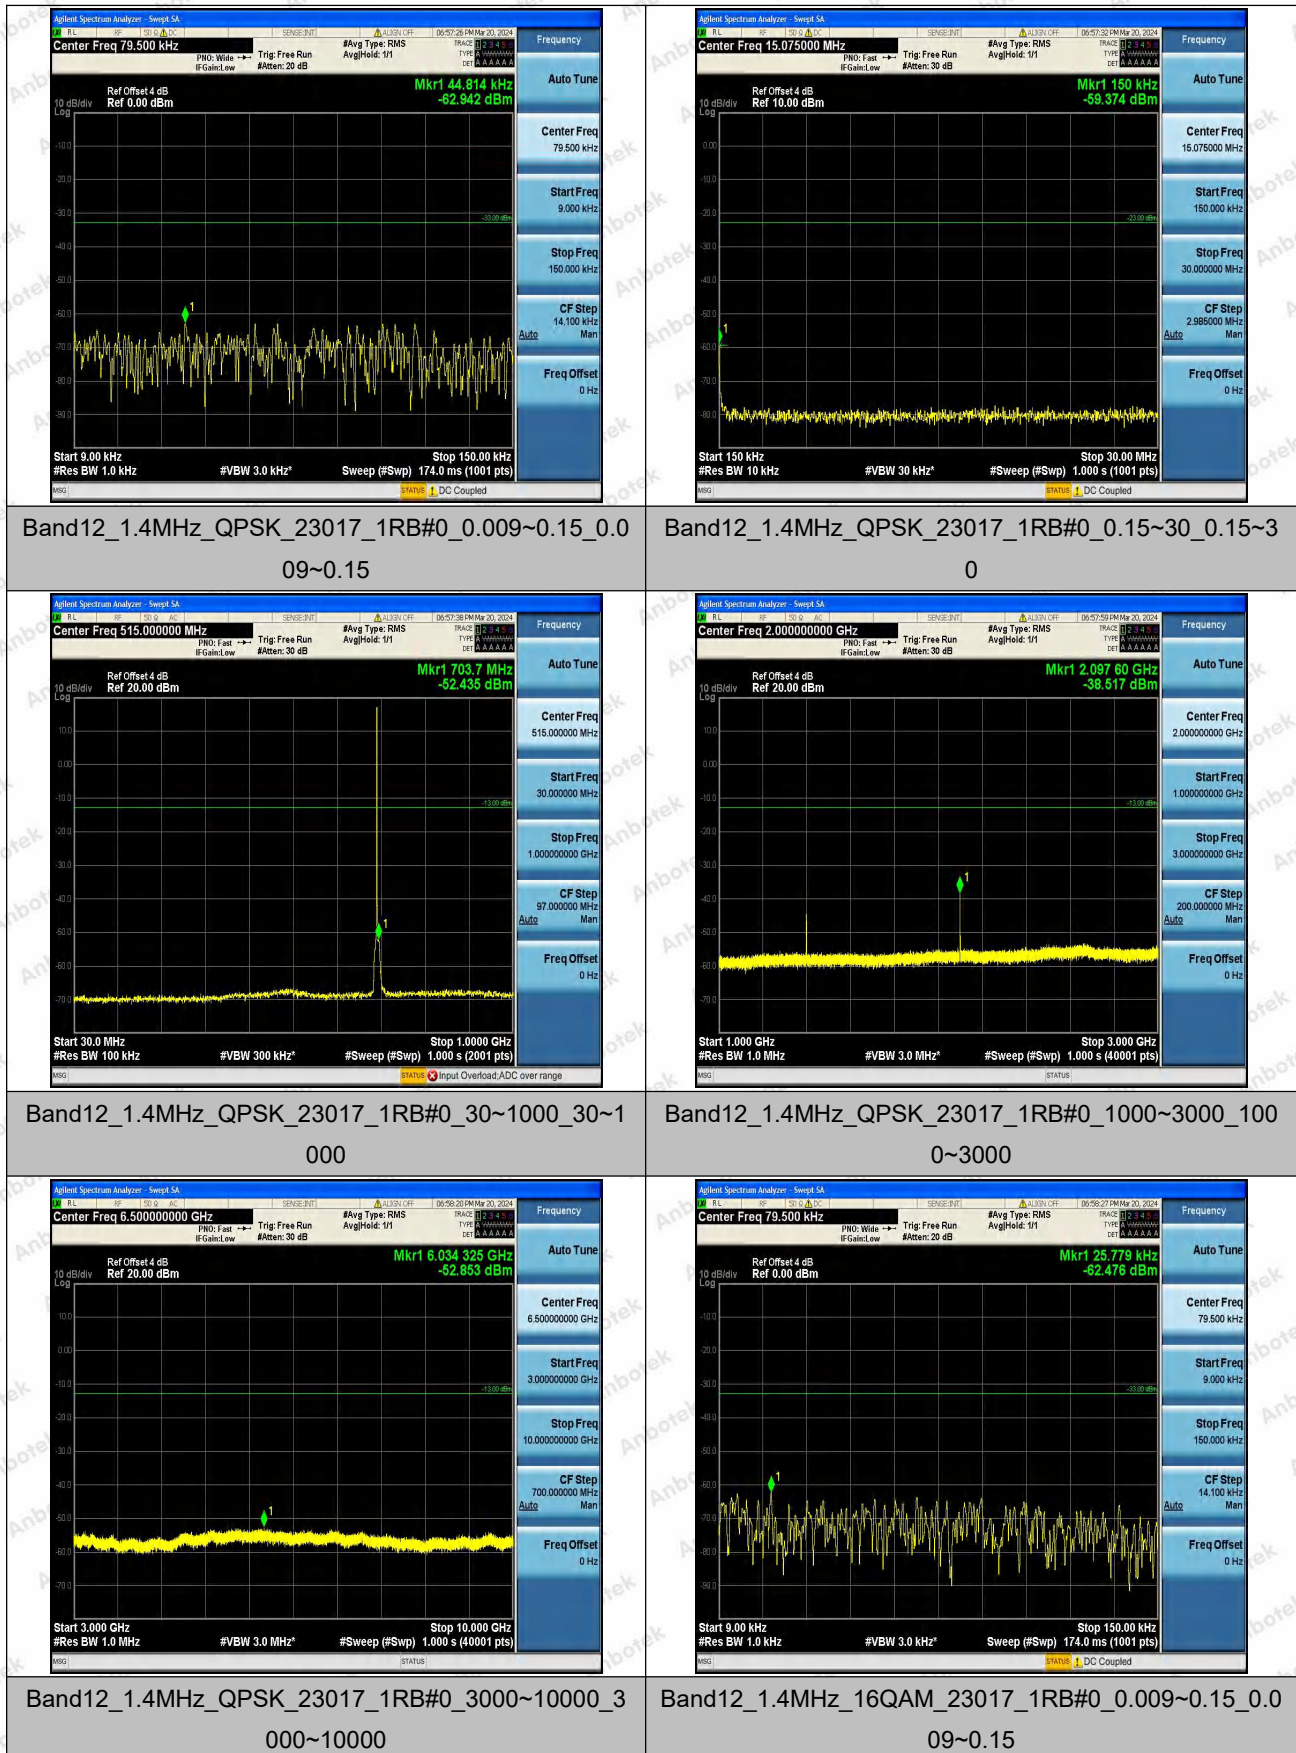

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline

400-003-0500

www.anbotek.com.cn



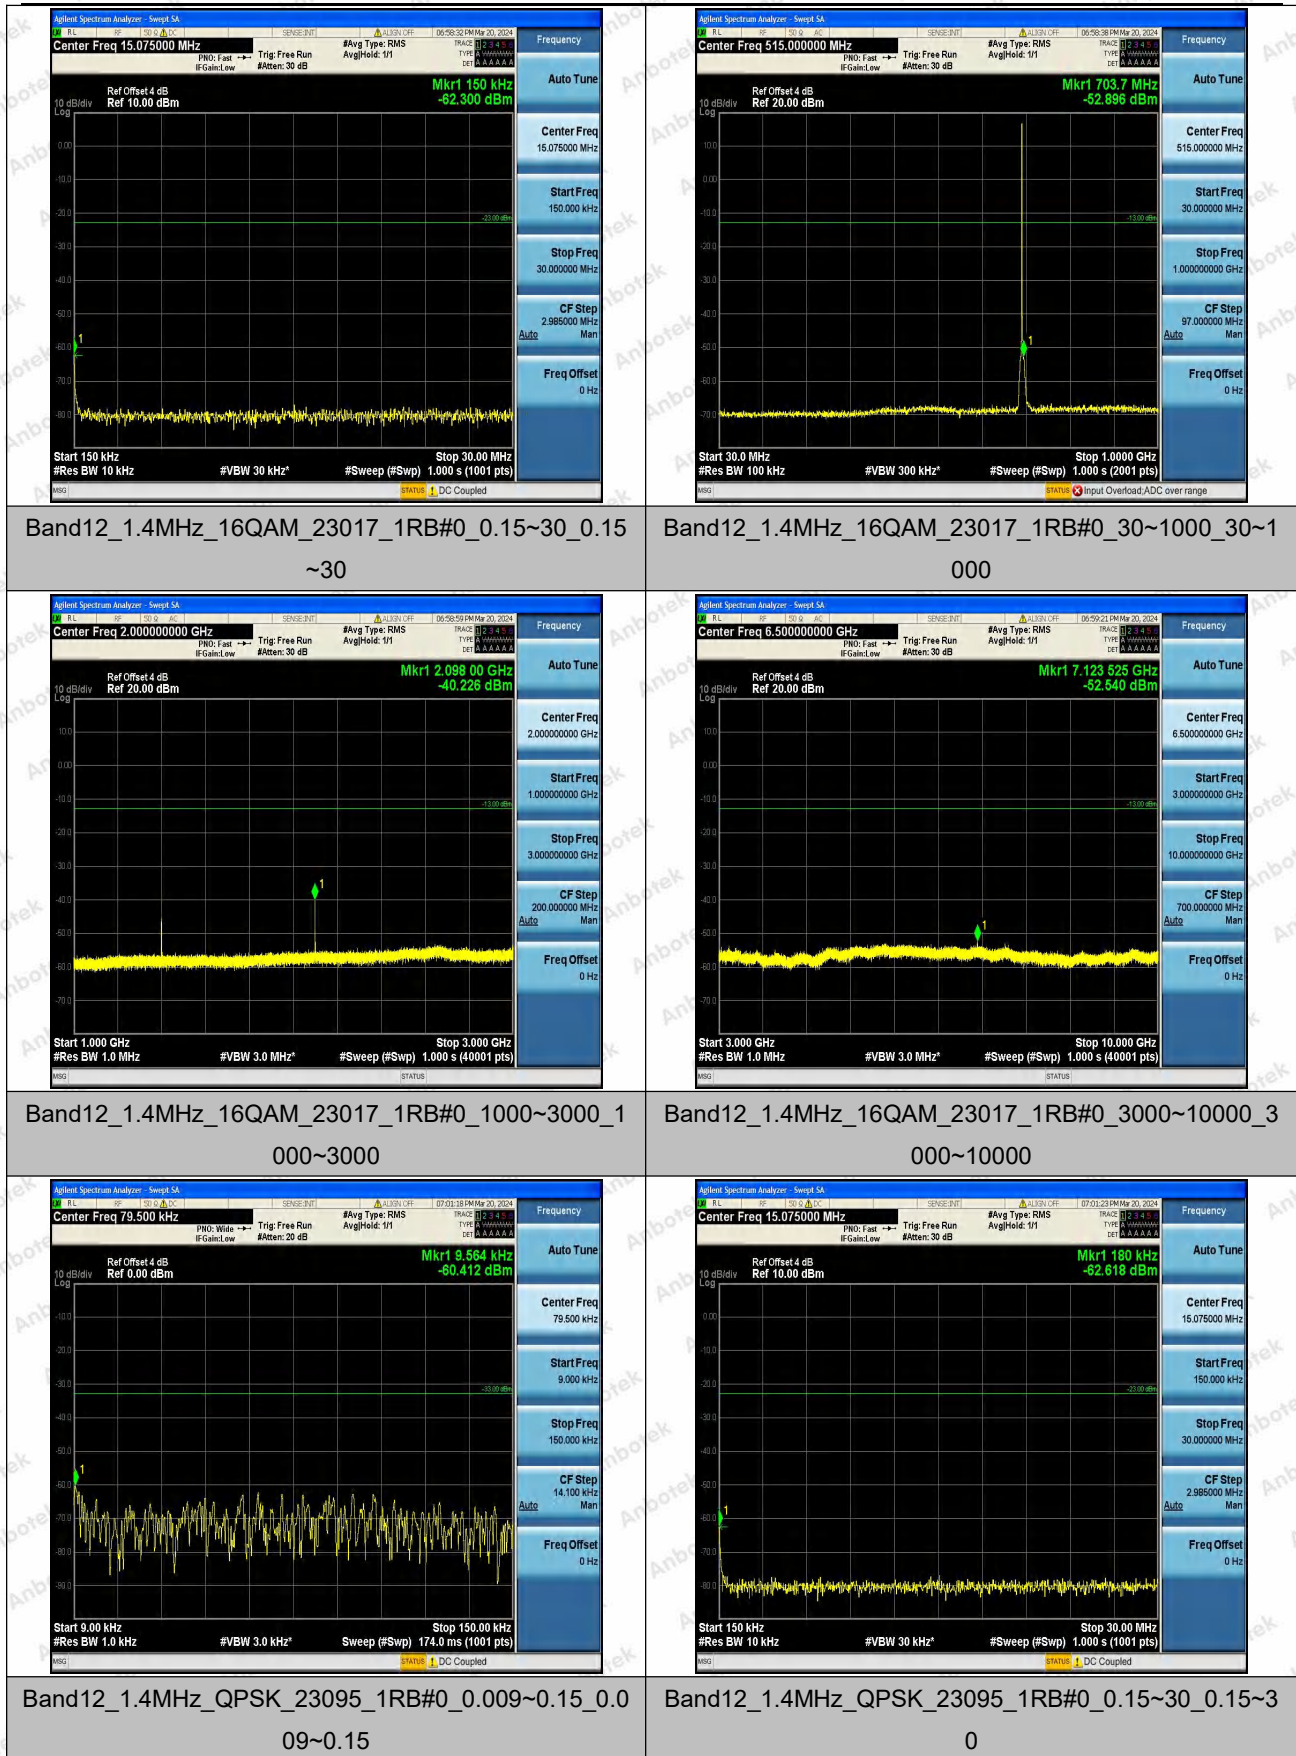

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline

400-003-0500

www.anbotek.com.cn



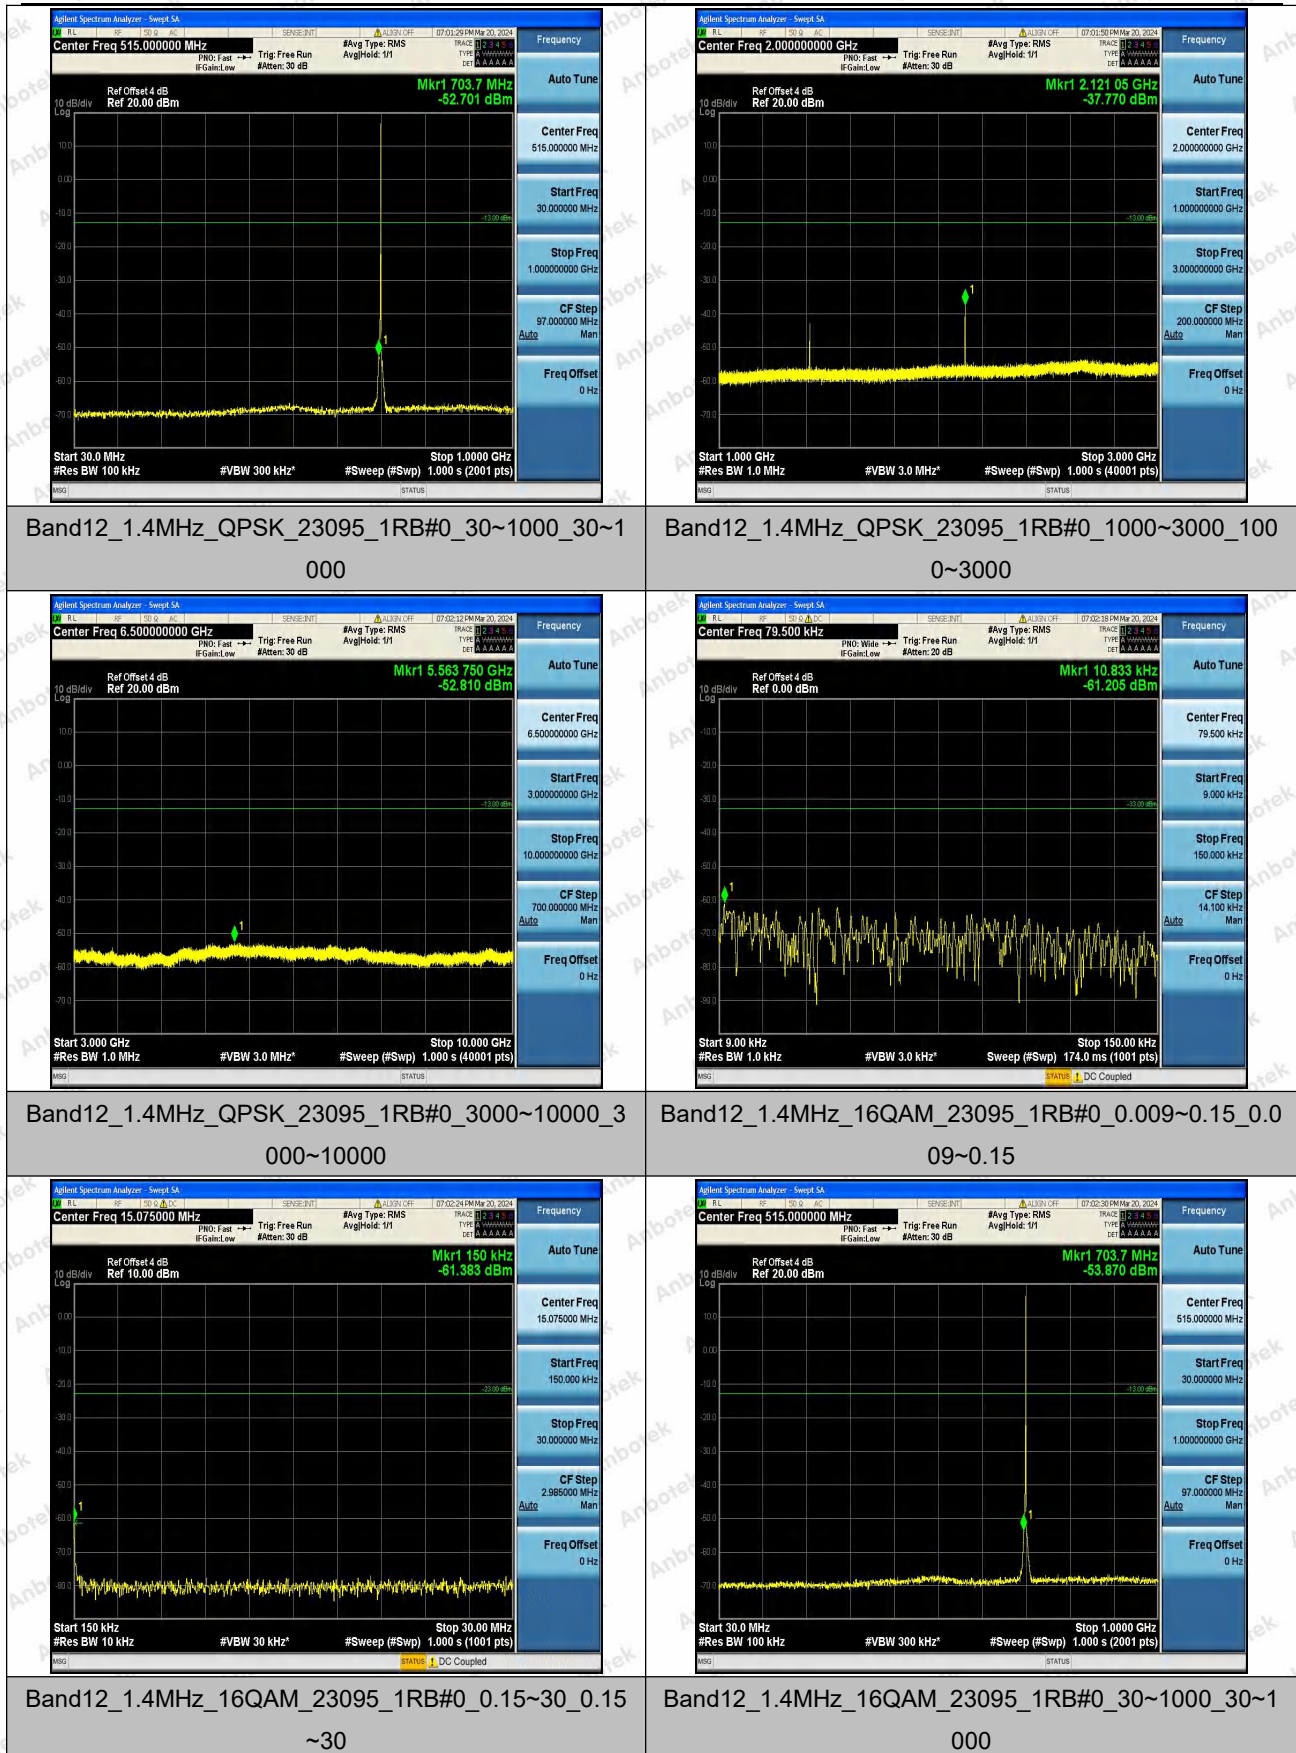


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com.cn




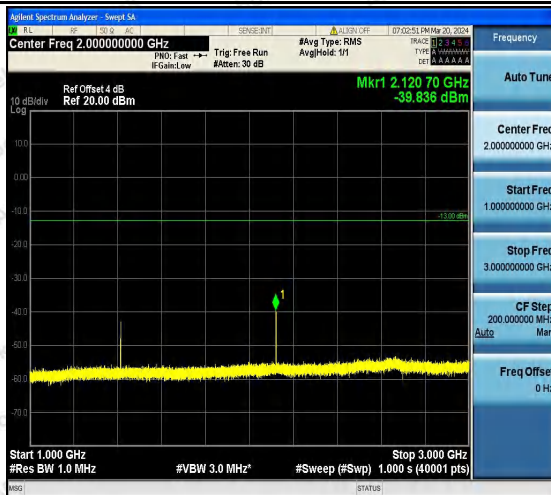


Band12_1.4MHz_16QAM_23095_1RB#0_1000~3000_1
000~3000

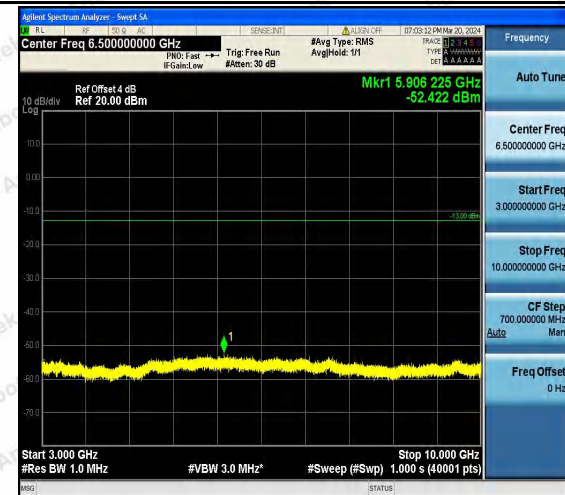


Band12_1.4MHz_16QAM_23095_1RB#0_3000~10000_3
000~10000

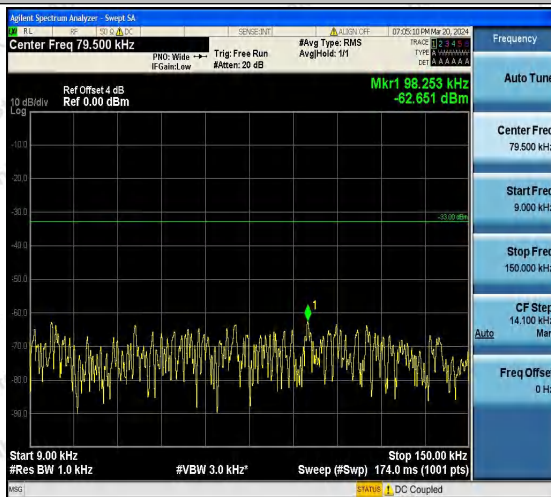


Band12_1.4MHz_QPSK_23173_1RB#0_0.009~0.15_0
09~0.15

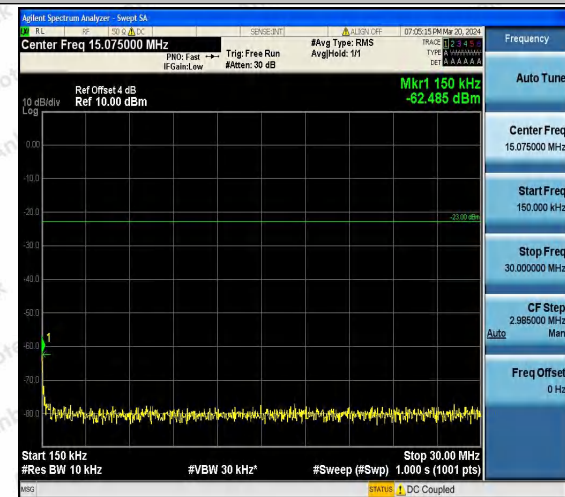

Band12_1.4MHz_QPSK_23173_1RB#0_0.15~30_0.15~3
0

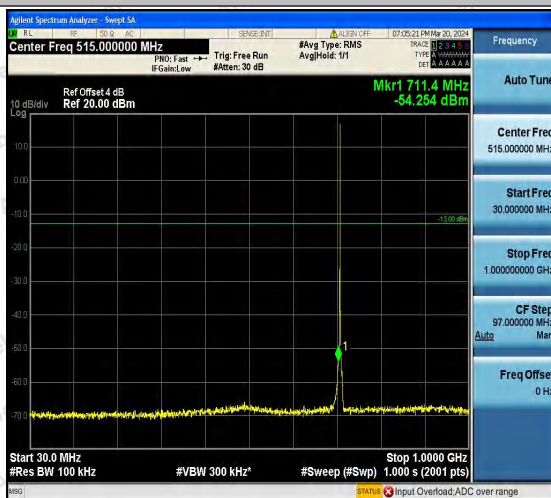


Band12_1.4MHz_QPSK_23173_1RB#0_30~1000_30~1
000

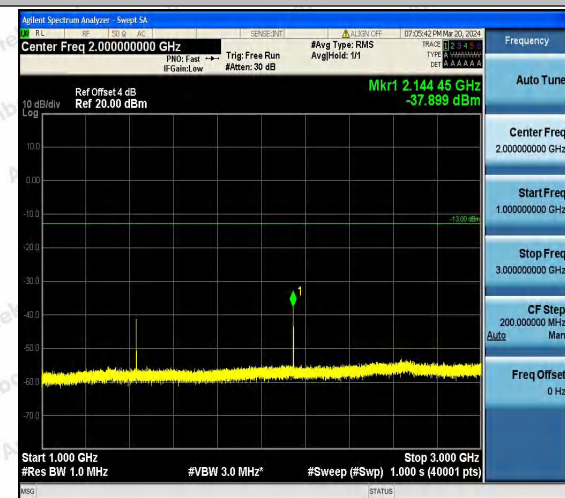


Band12_1.4MHz_QPSK_23173_1RB#0_1000~3000_100
0~3000




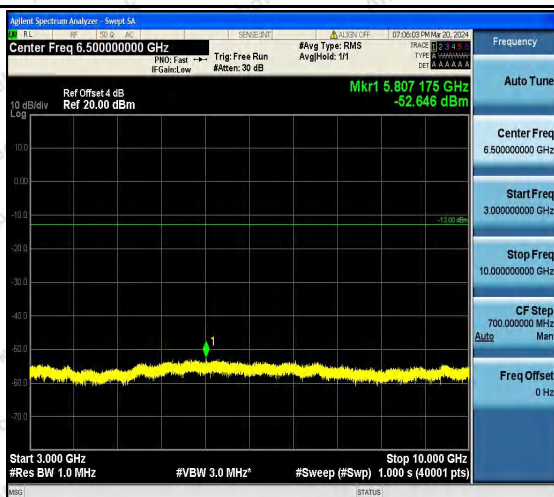


Band12_1.4MHz_QPSK_23173_1RB#0_3000~10000_3
000~10000

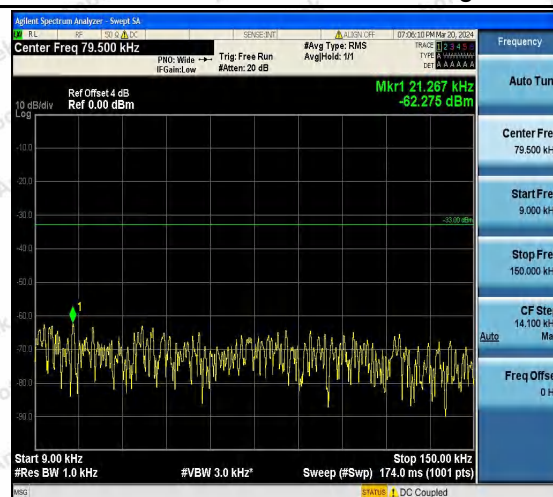


Band12_1.4MHz_16QAM_23173_1RB#0_0.009~0.15_0.0
09~0.15

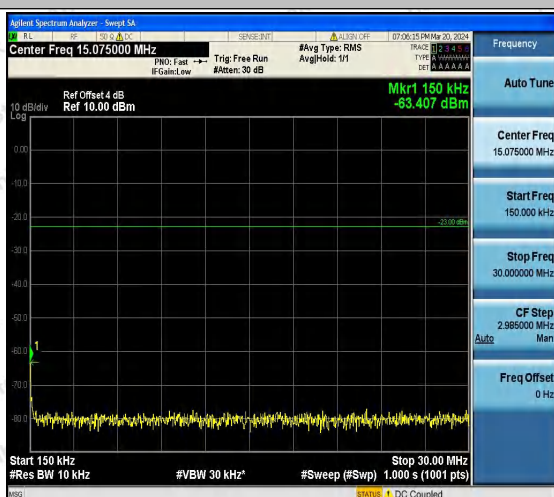


Band12_1.4MHz_16QAM_23173_1RB#0_0.15~30_0.15
~30

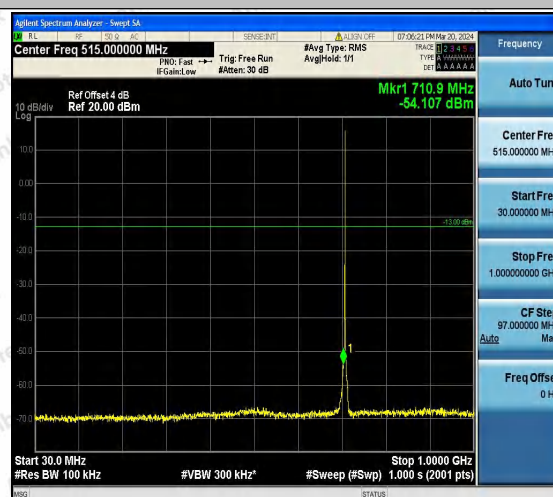

Band12_1.4MHz_16QAM_23173_1RB#0_30~1000_30~1
000

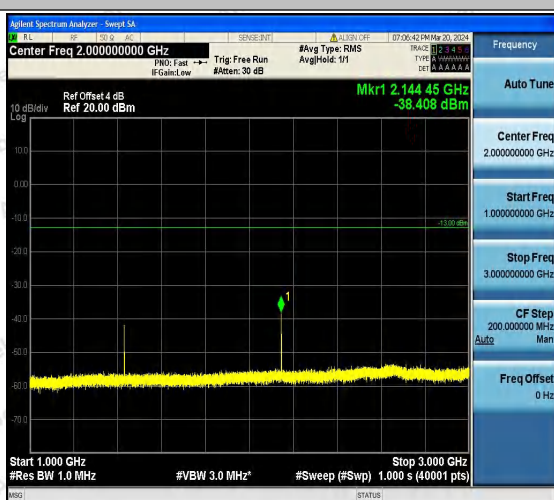



Band12_1.4MHz_16QAM_23173_1RB#0_1000~3000_1
000~3000

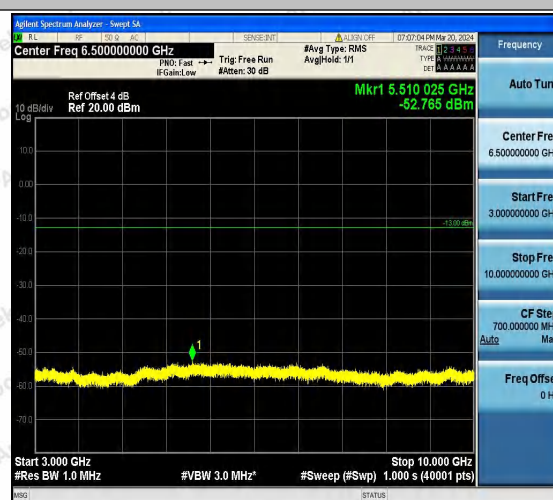

Band12_1.4MHz_16QAM_23173_1RB#0_3000~10000_3
000~10000



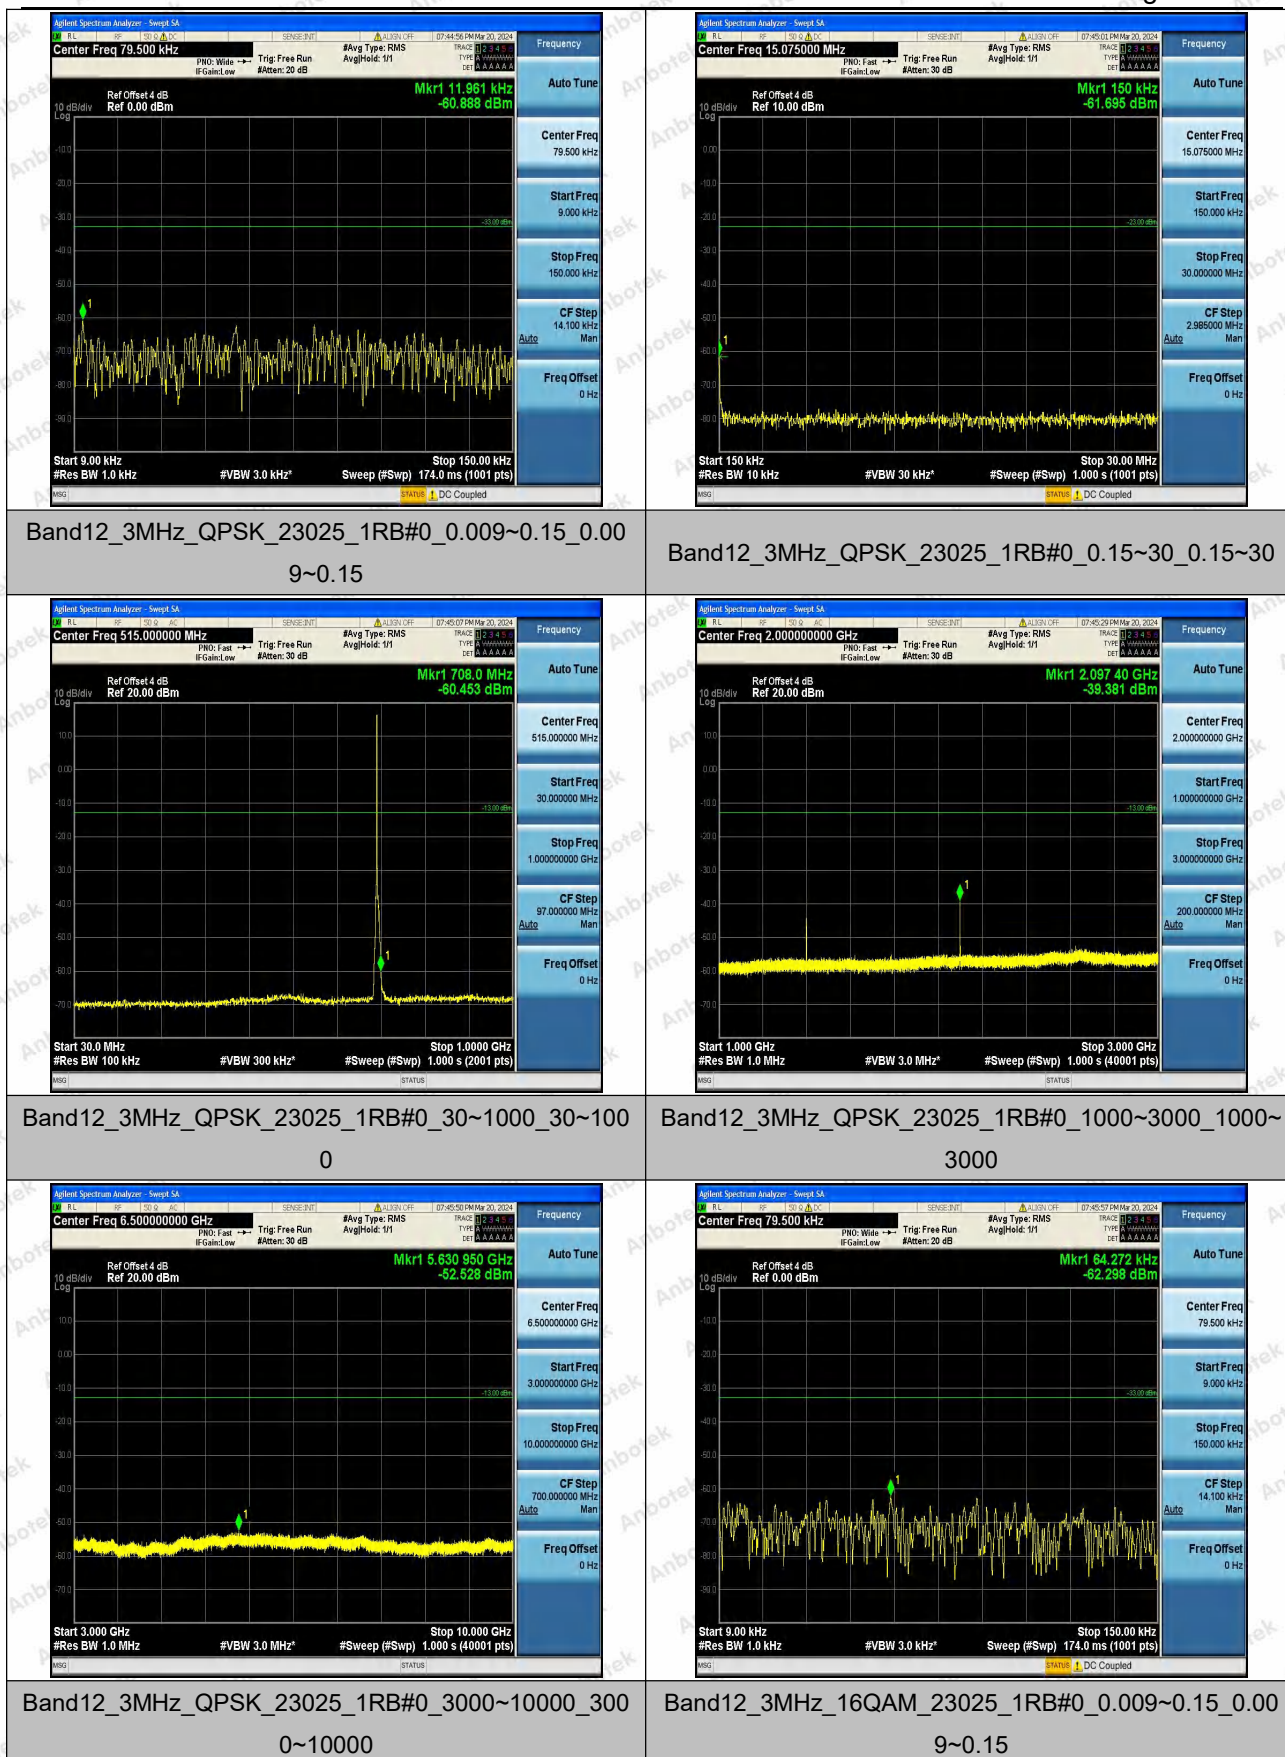

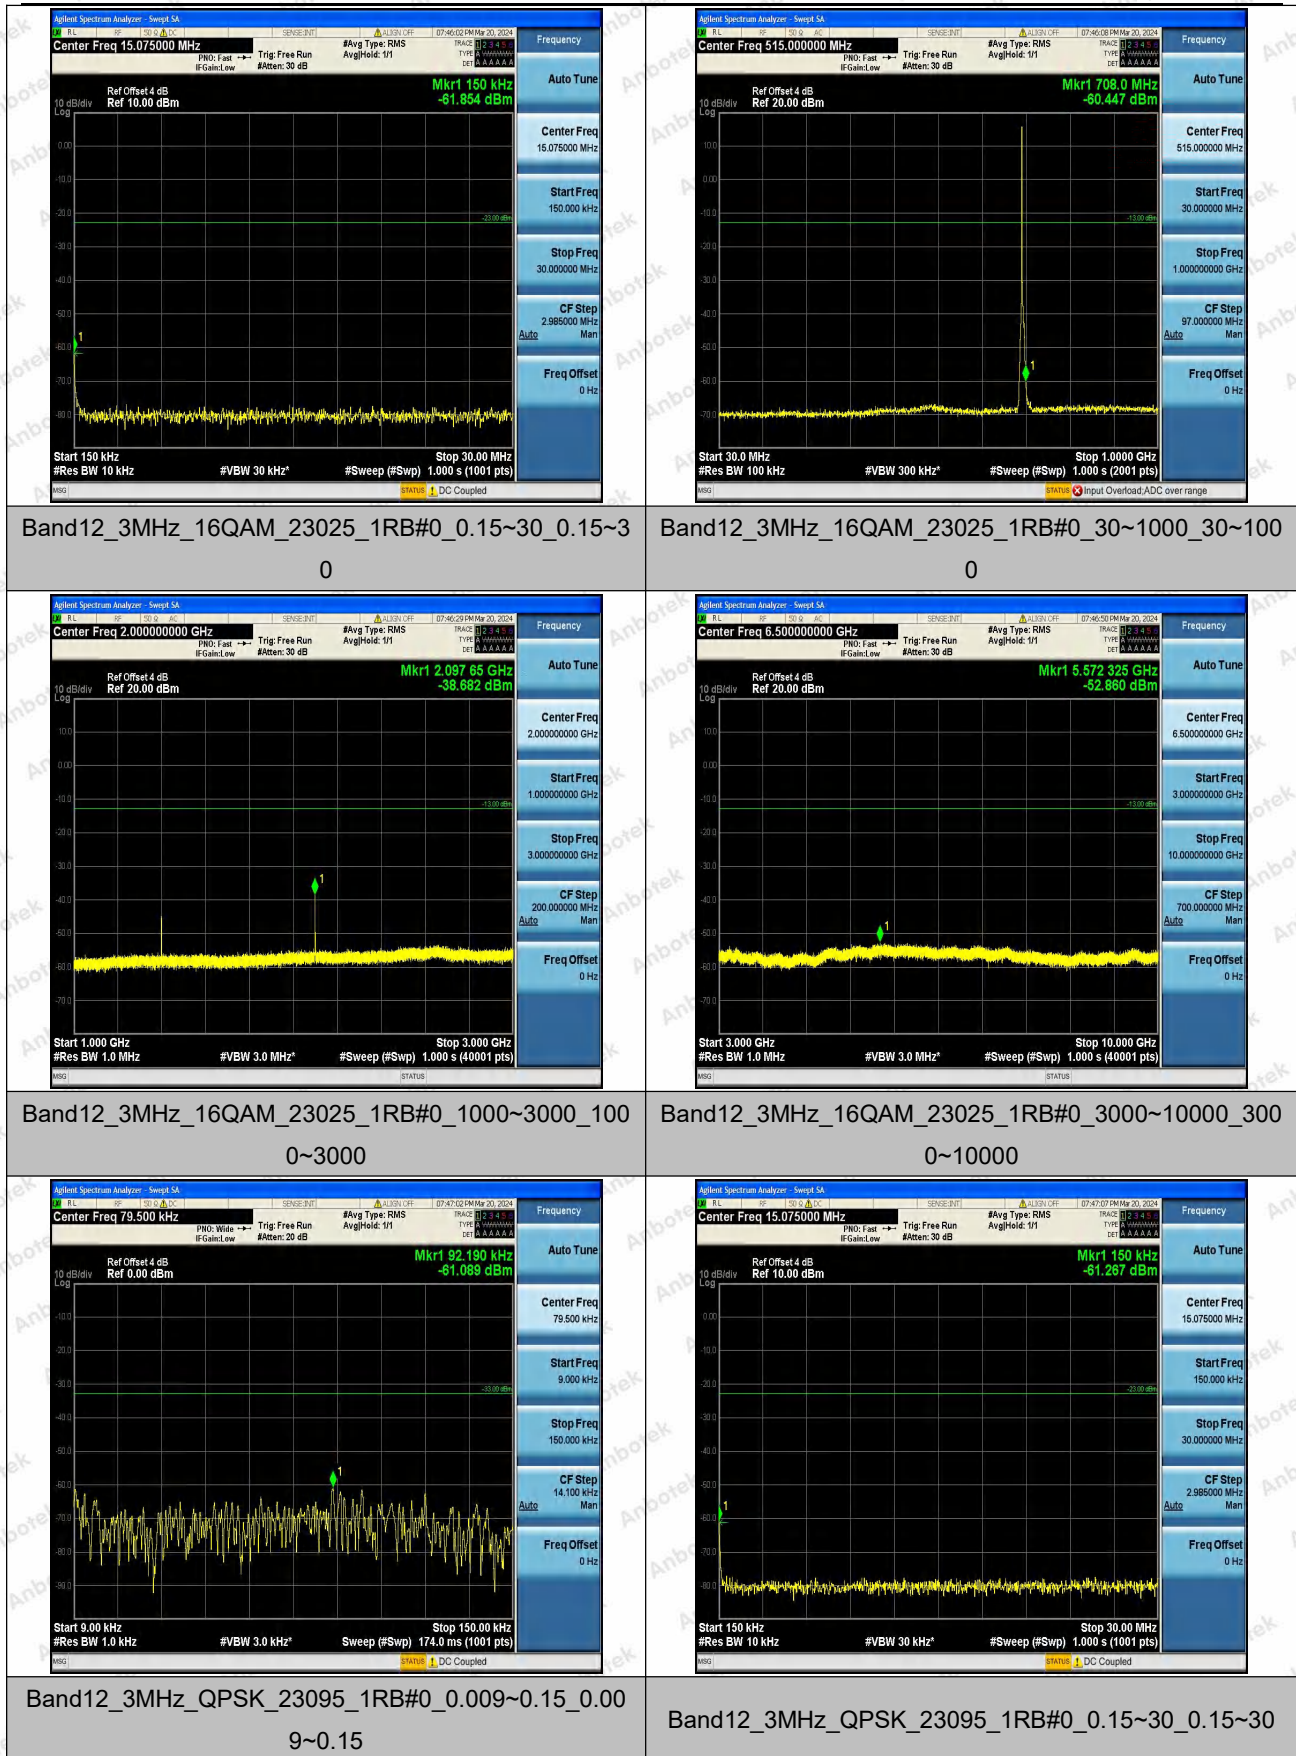

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com





Hotline

400-003-0500

www.anbotek.com.cn



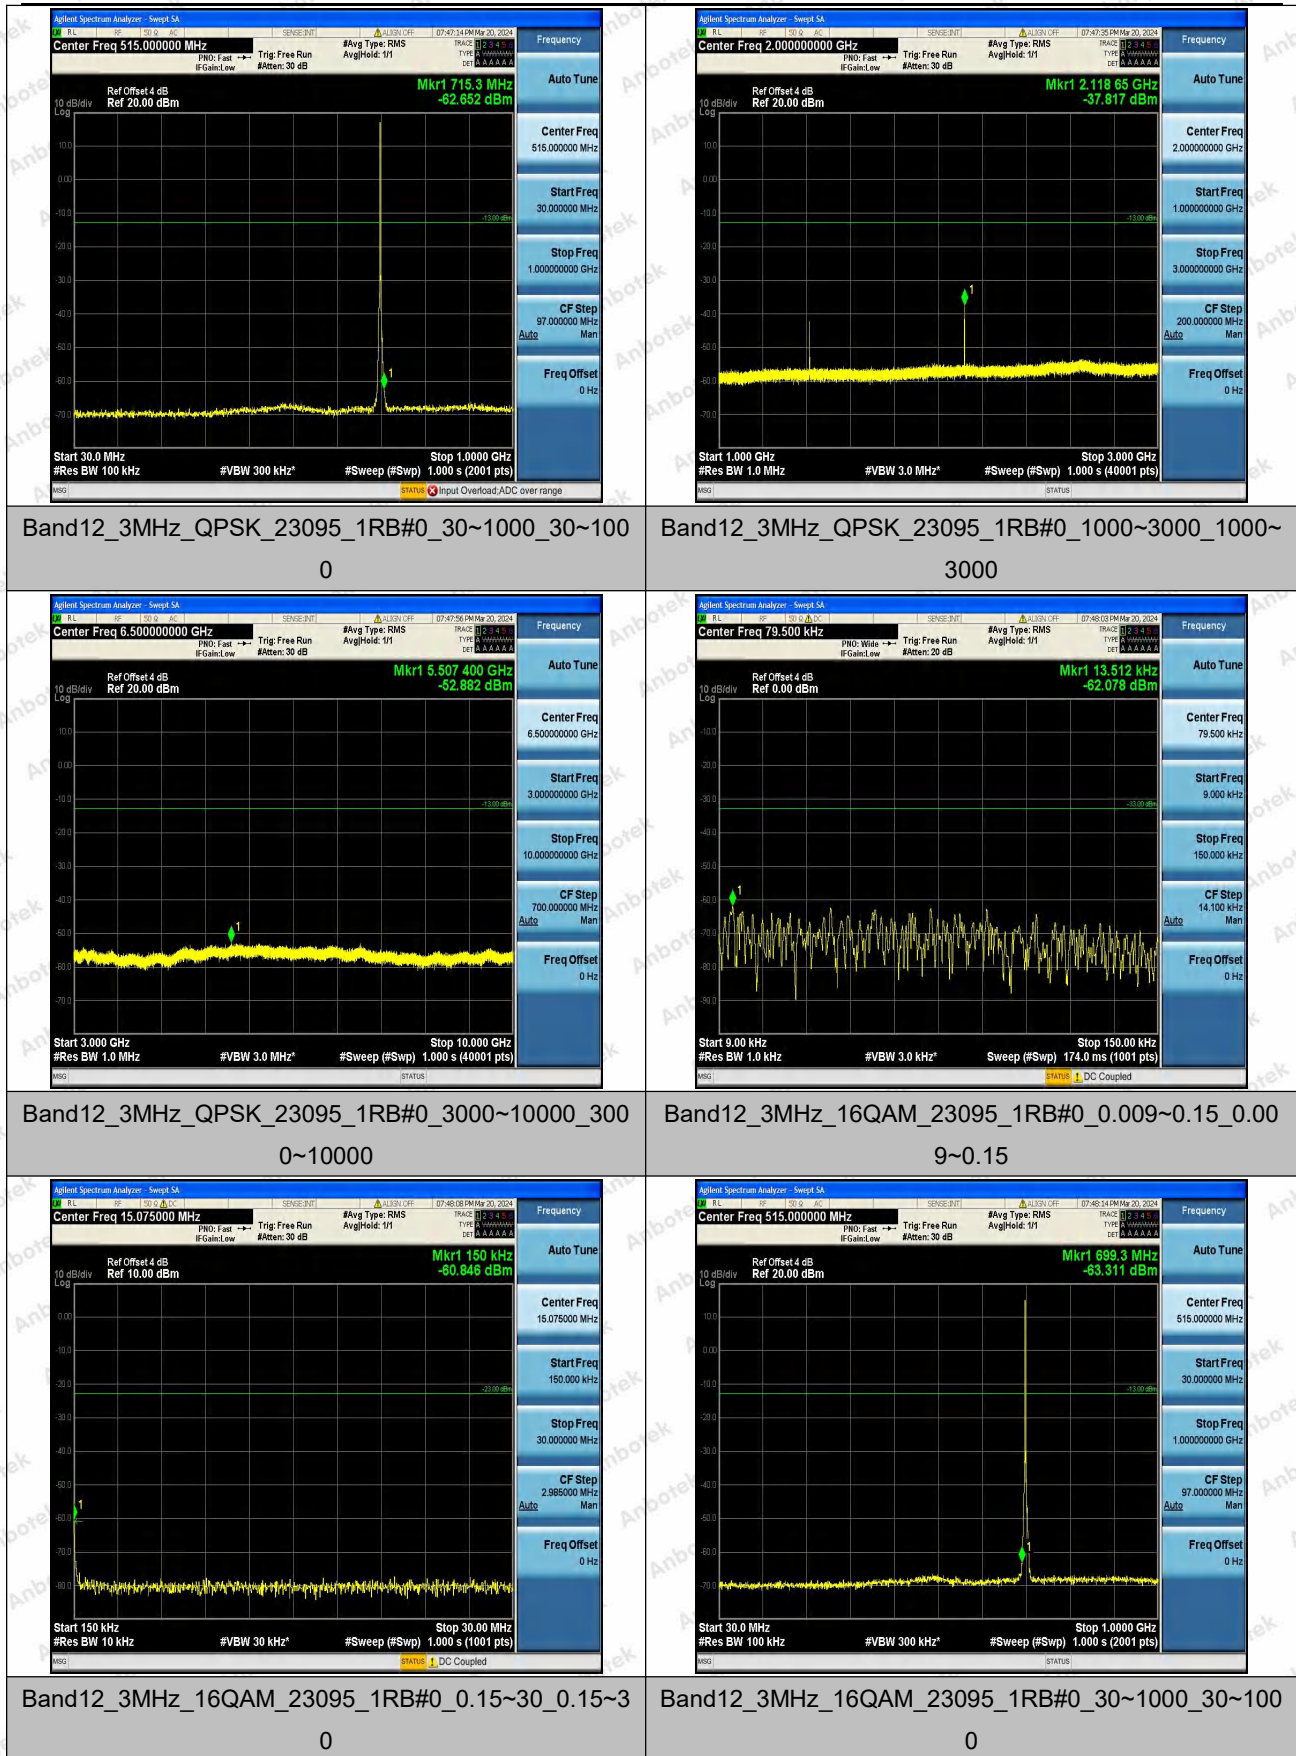

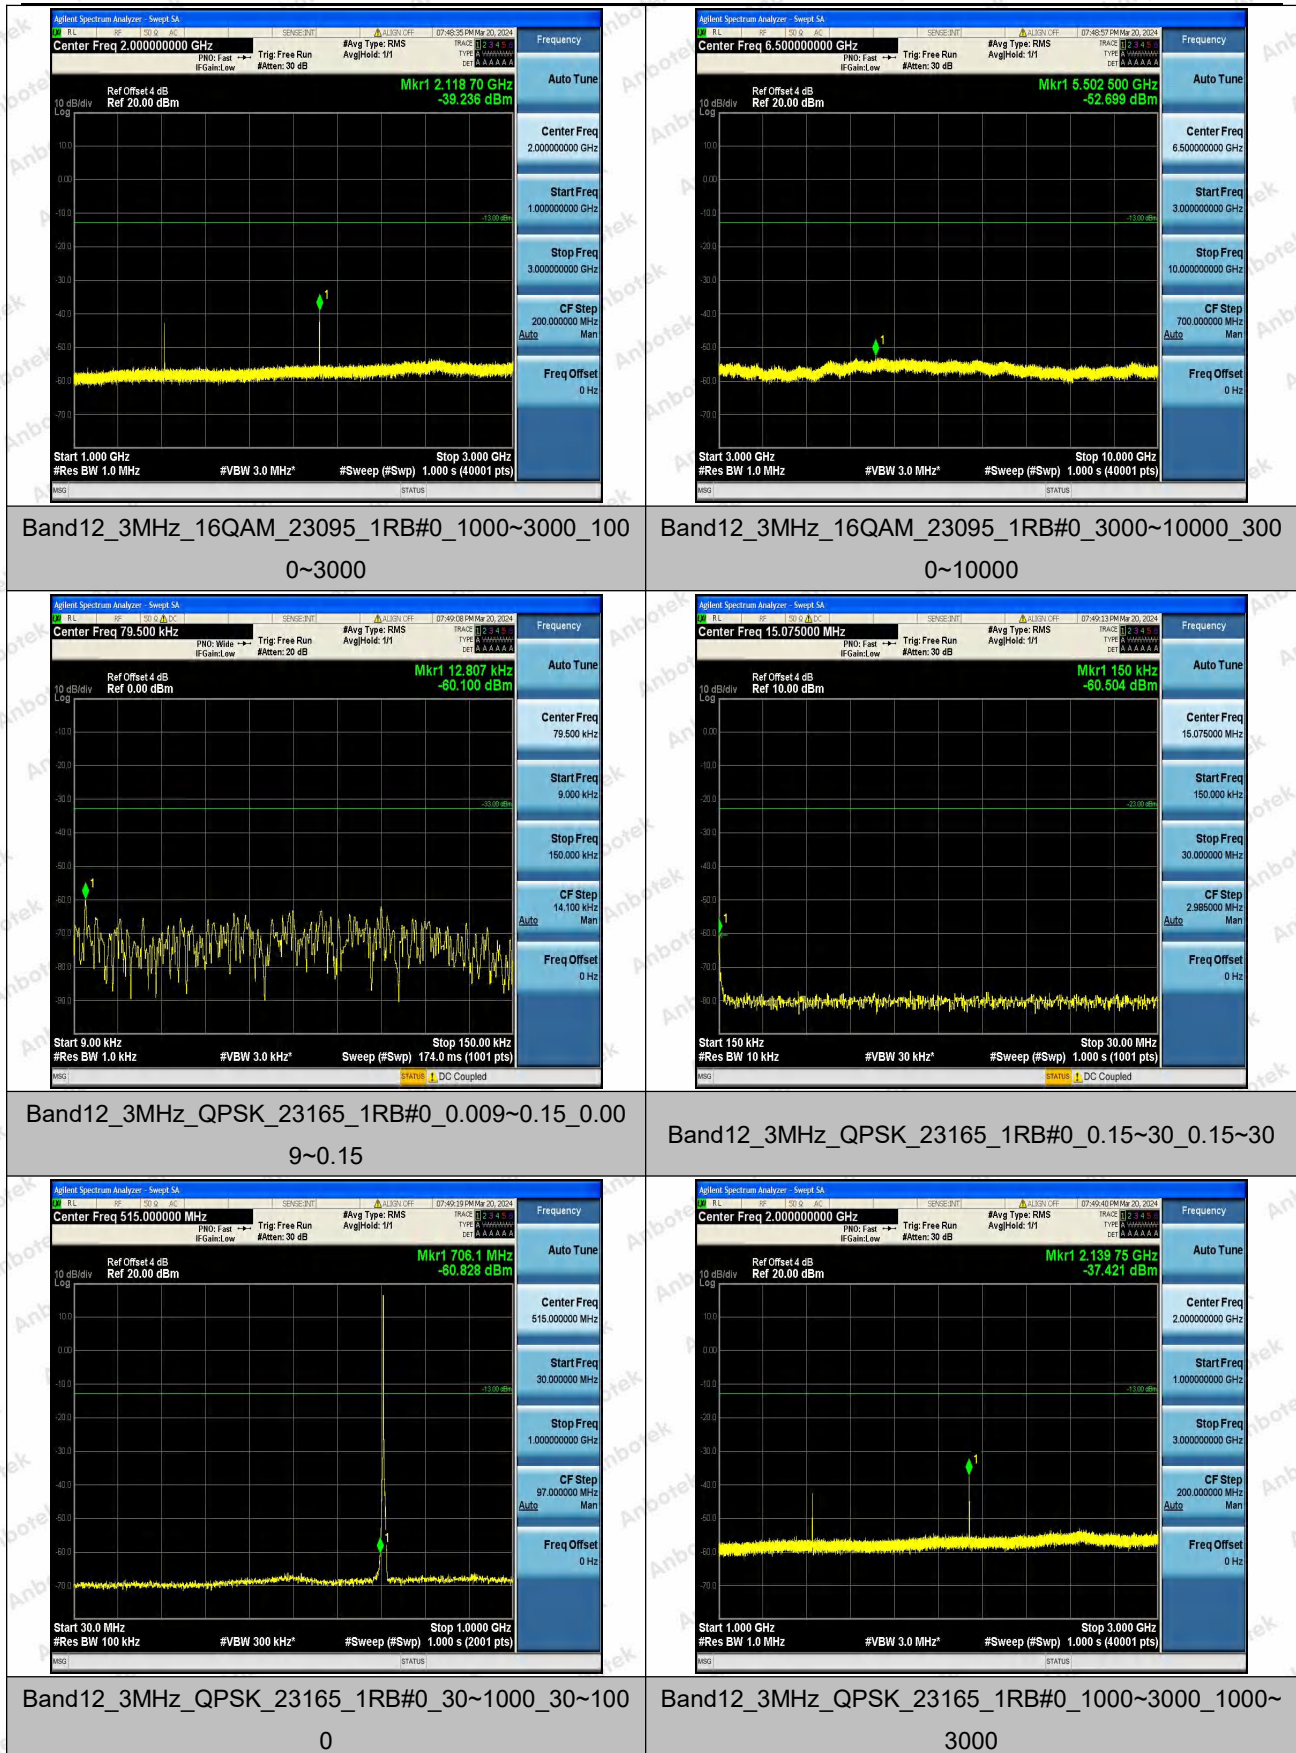


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



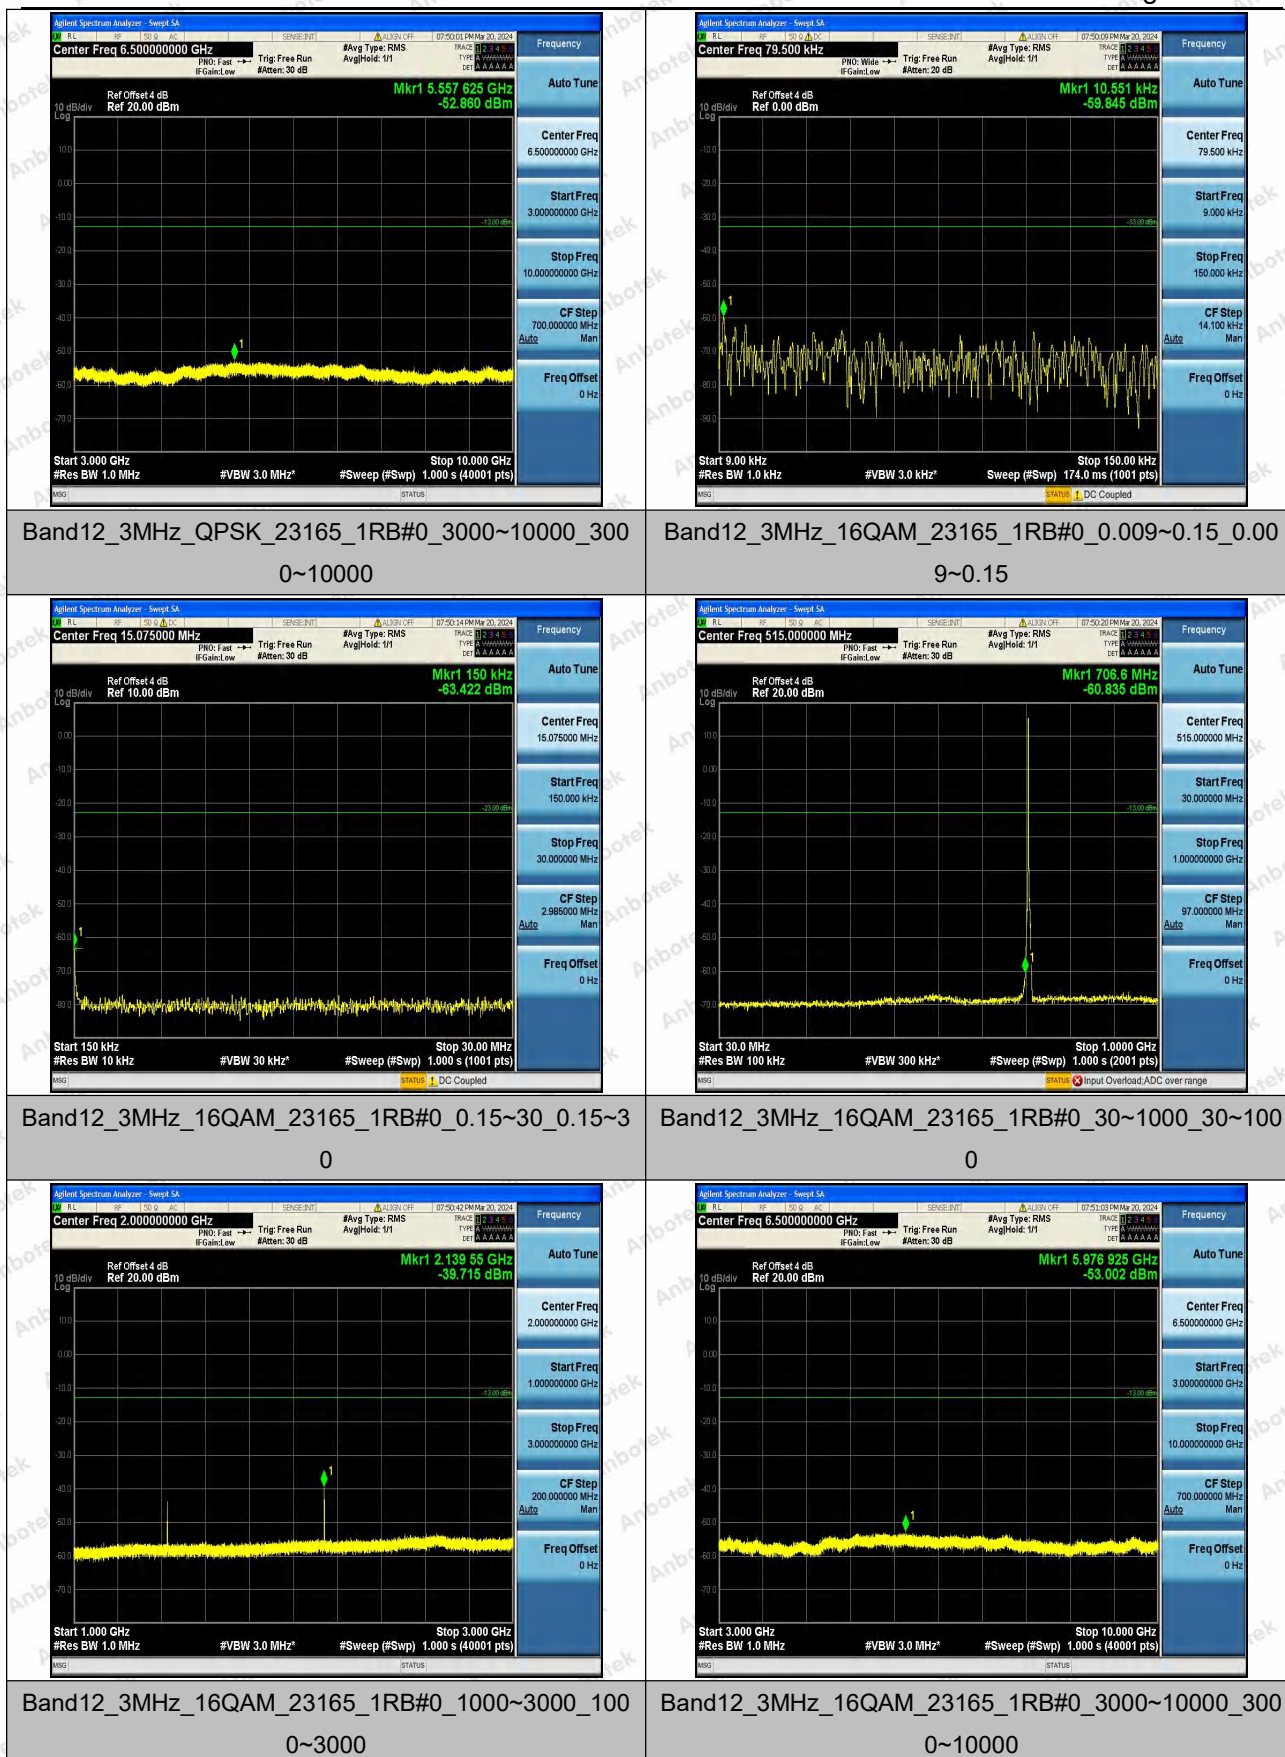

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com





Hotline

400-003-0500

www.anbotek.com.cn



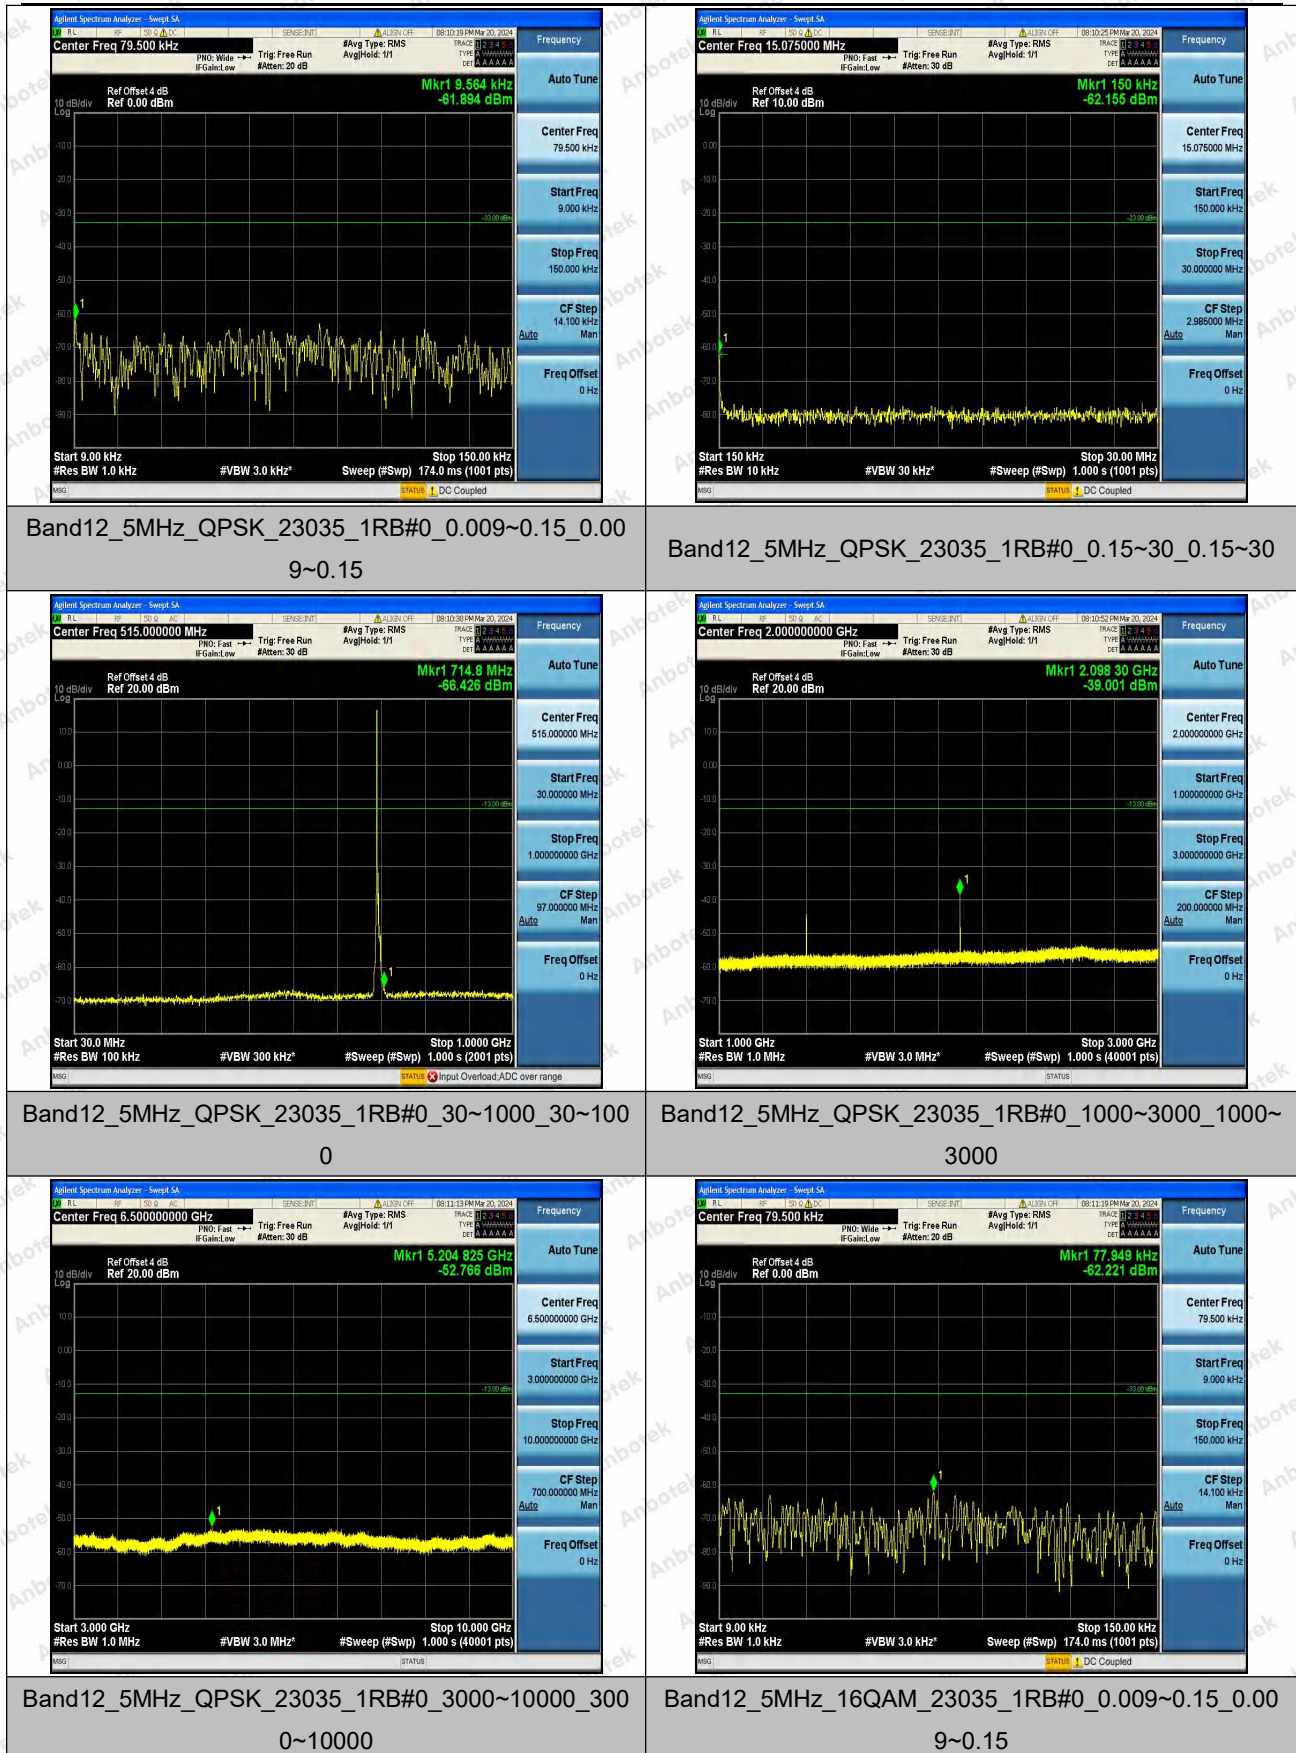

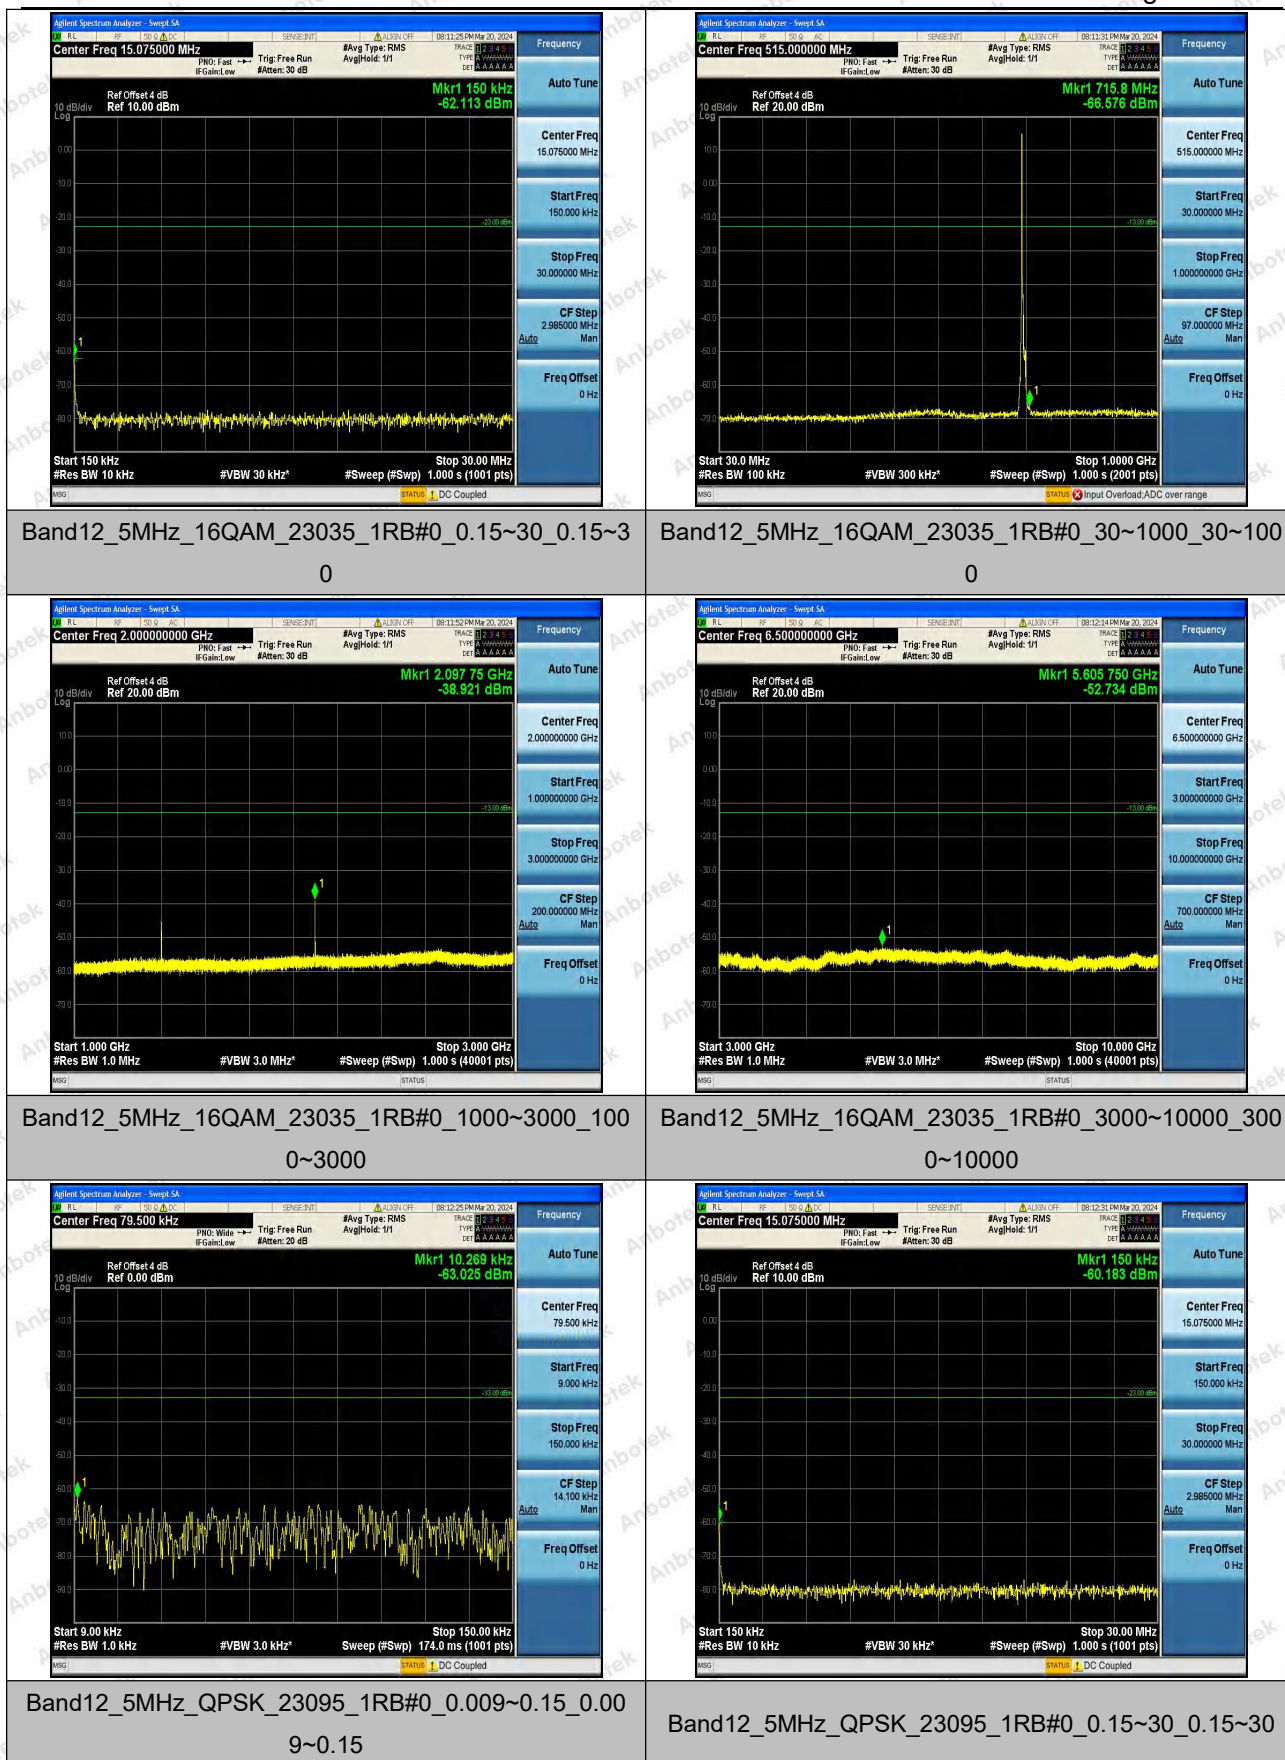


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



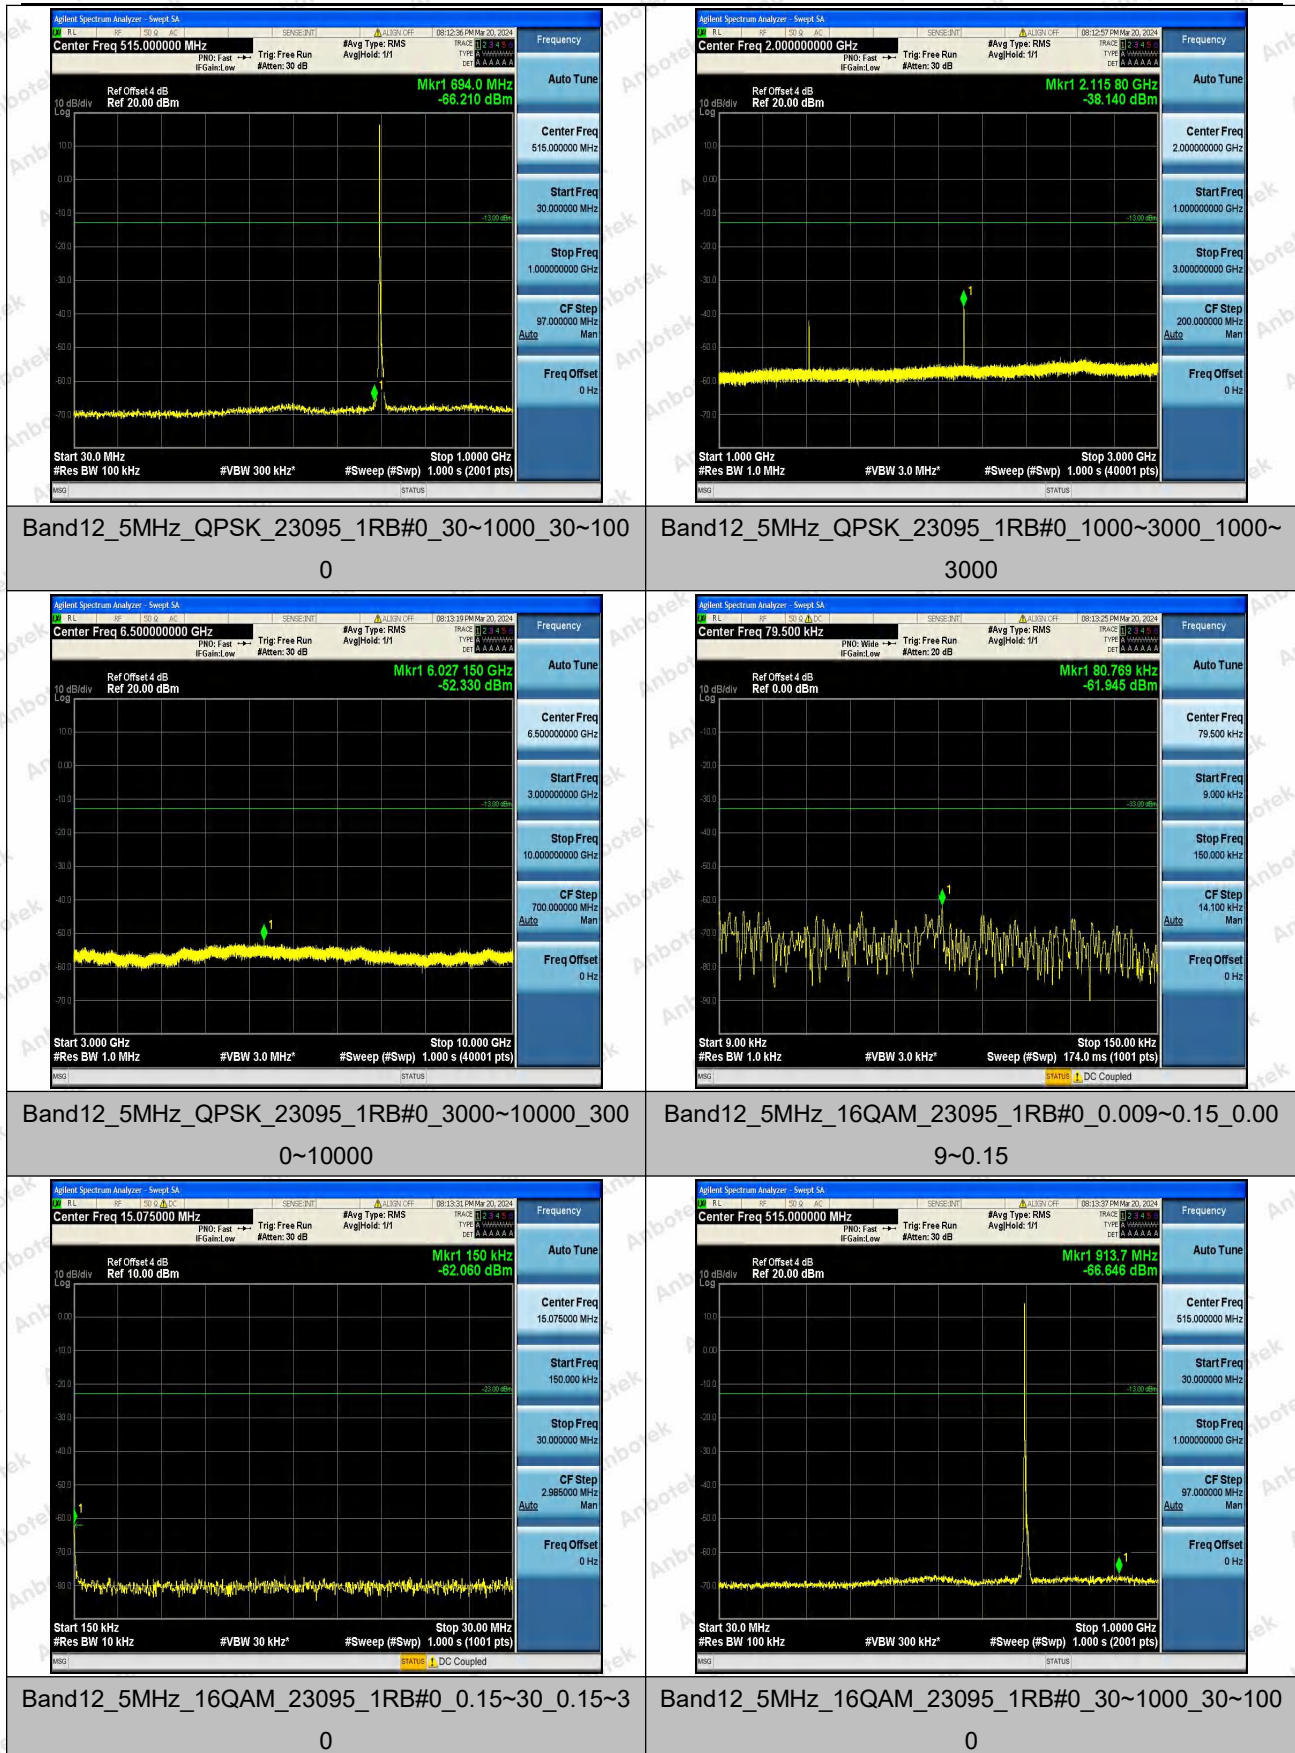

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline

400-003-0500

www.anbotek.com.cn



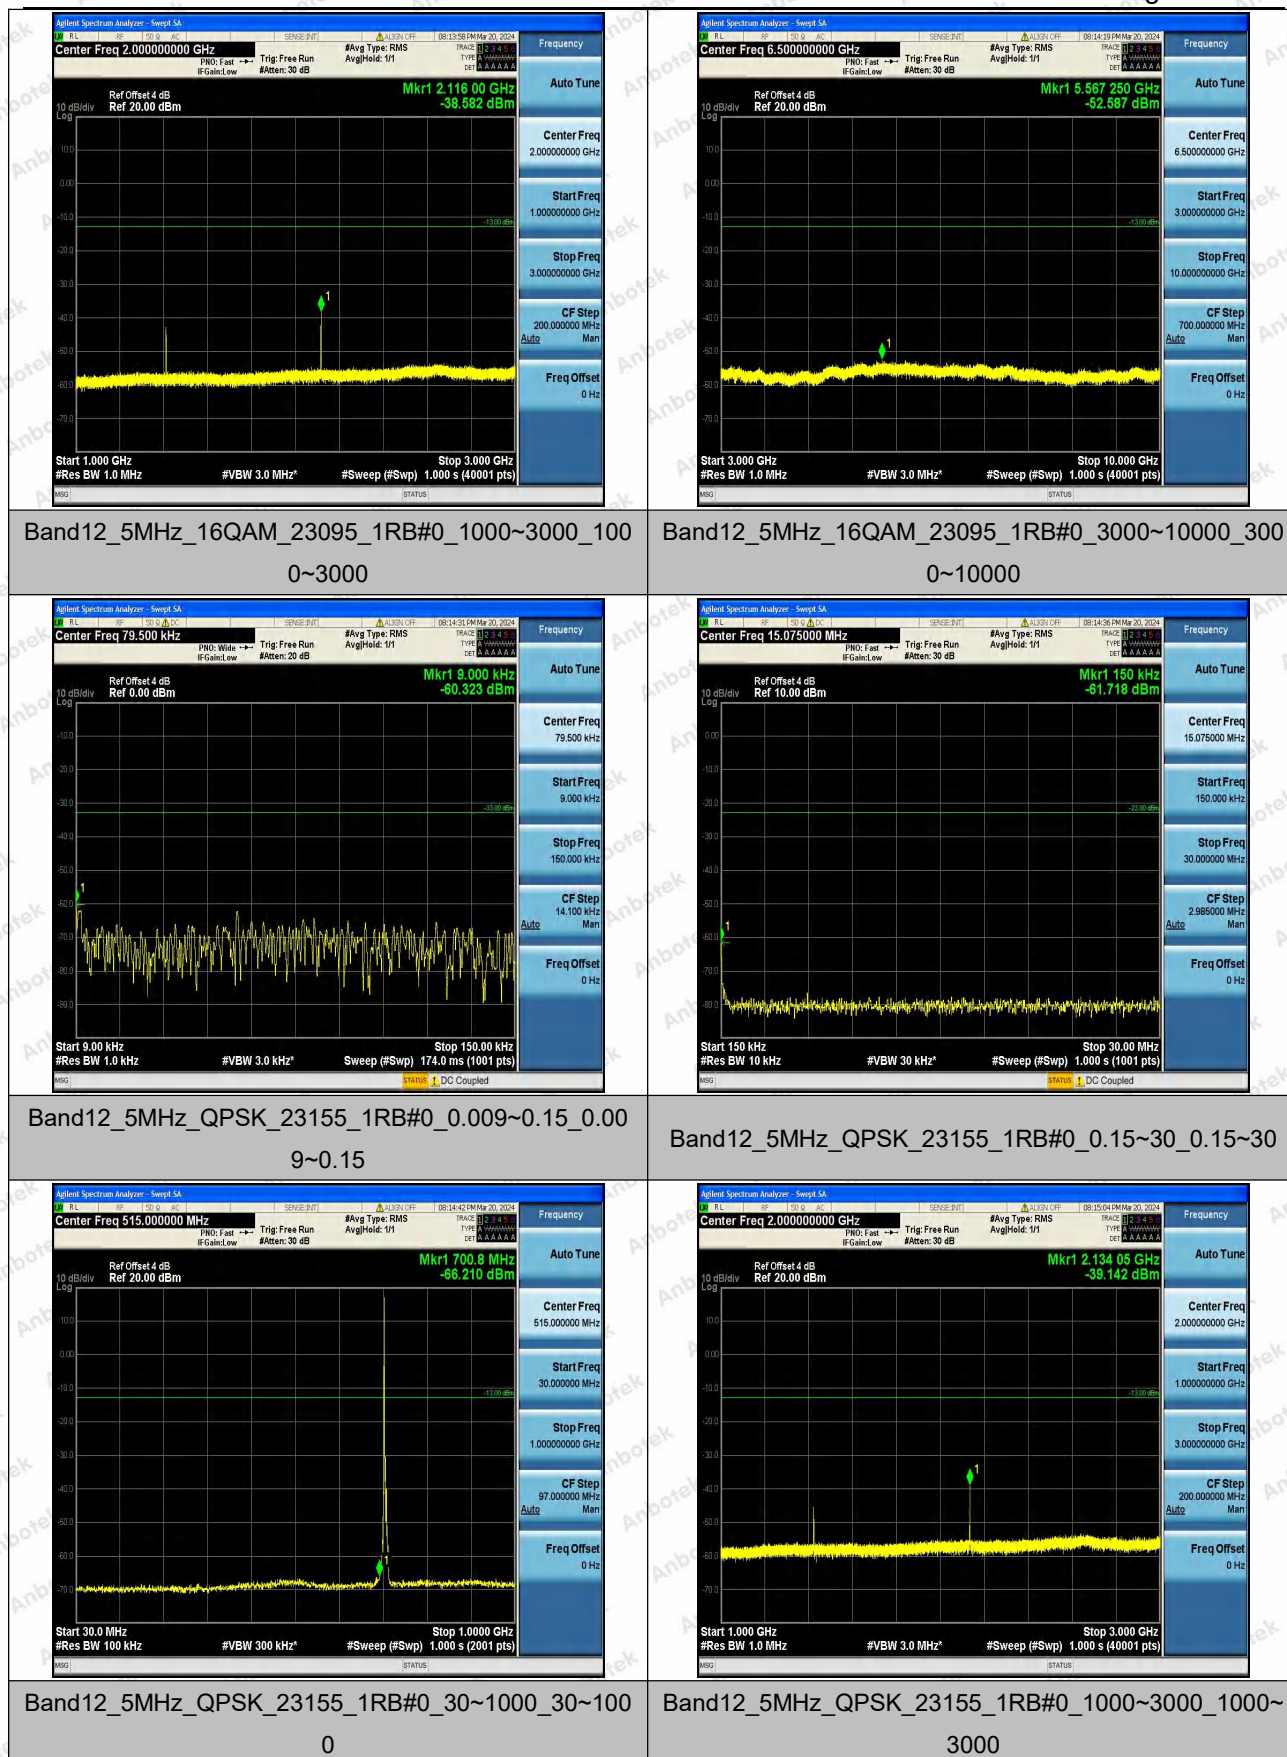


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



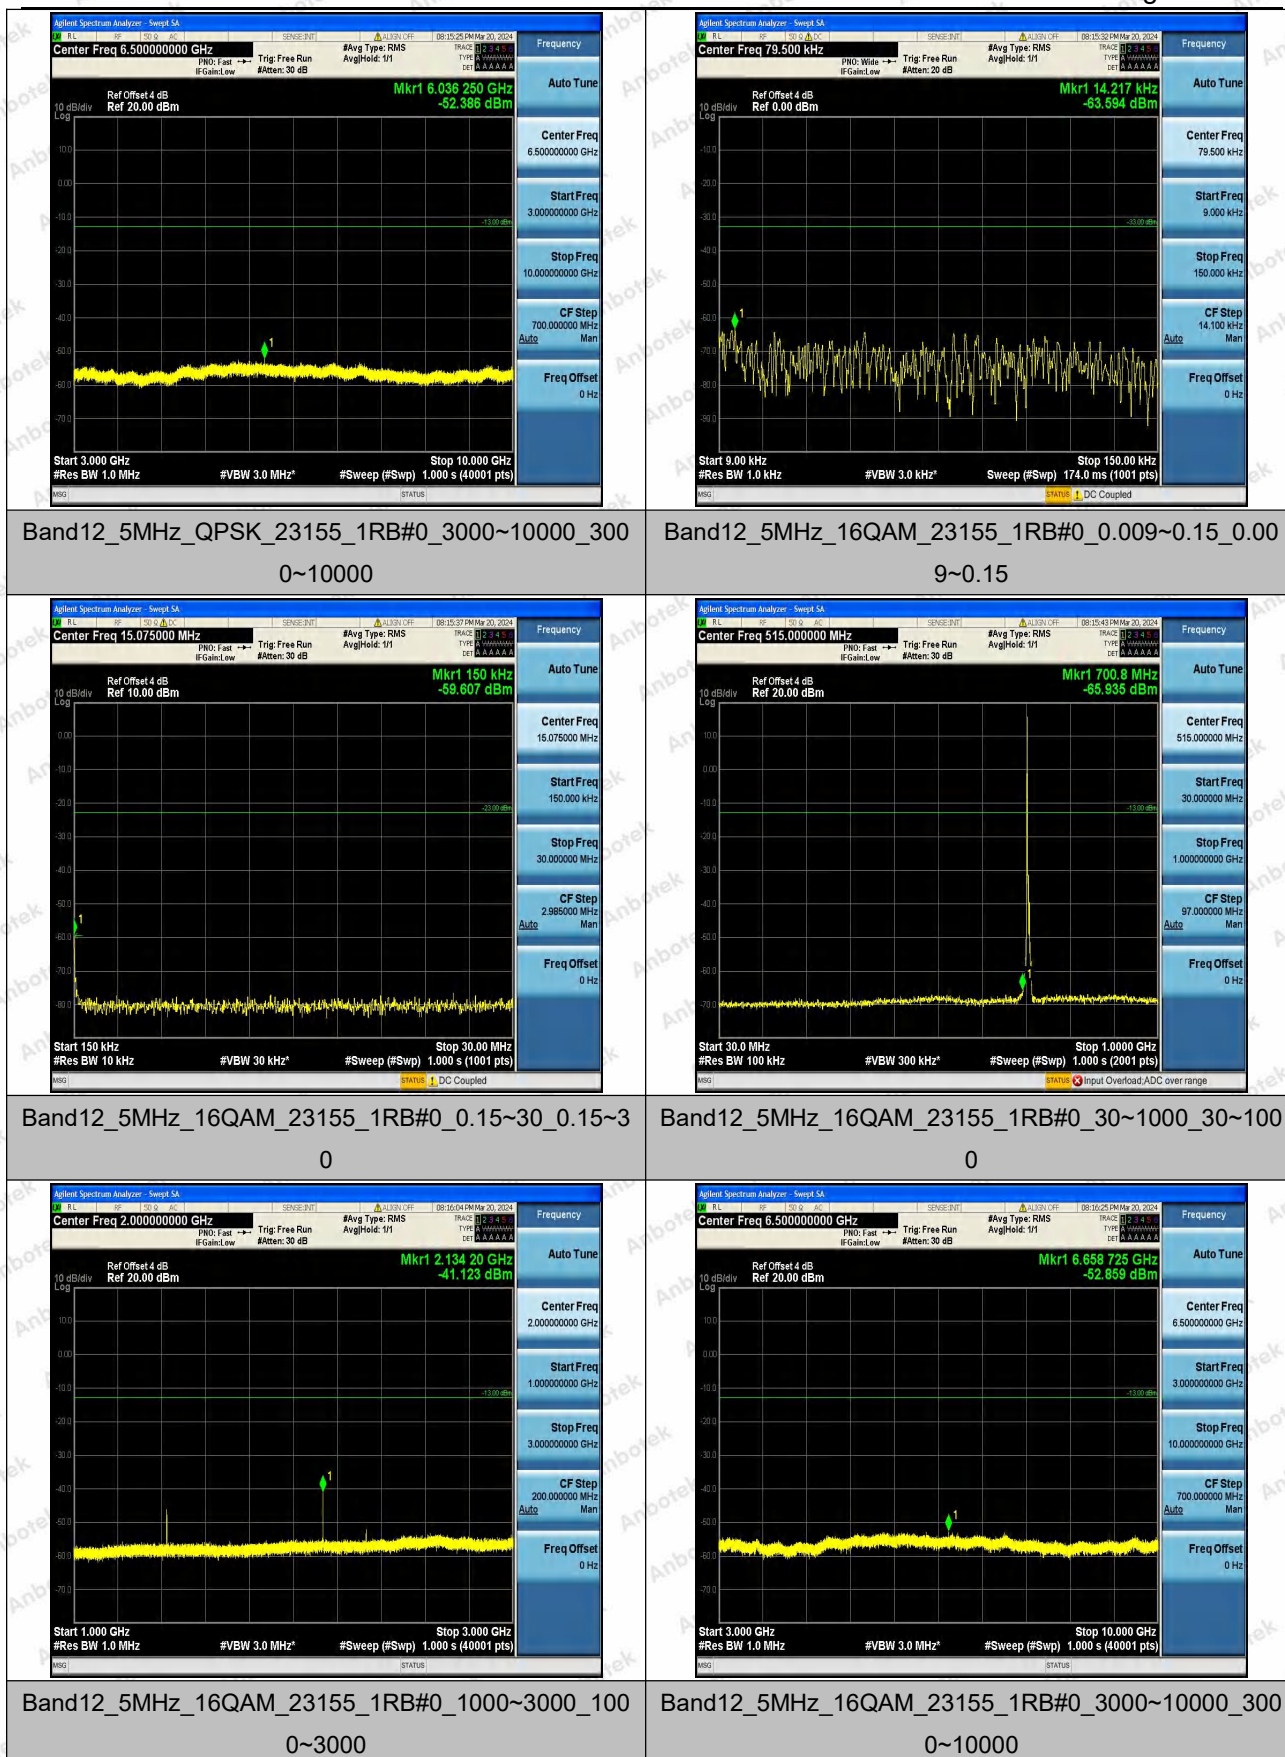

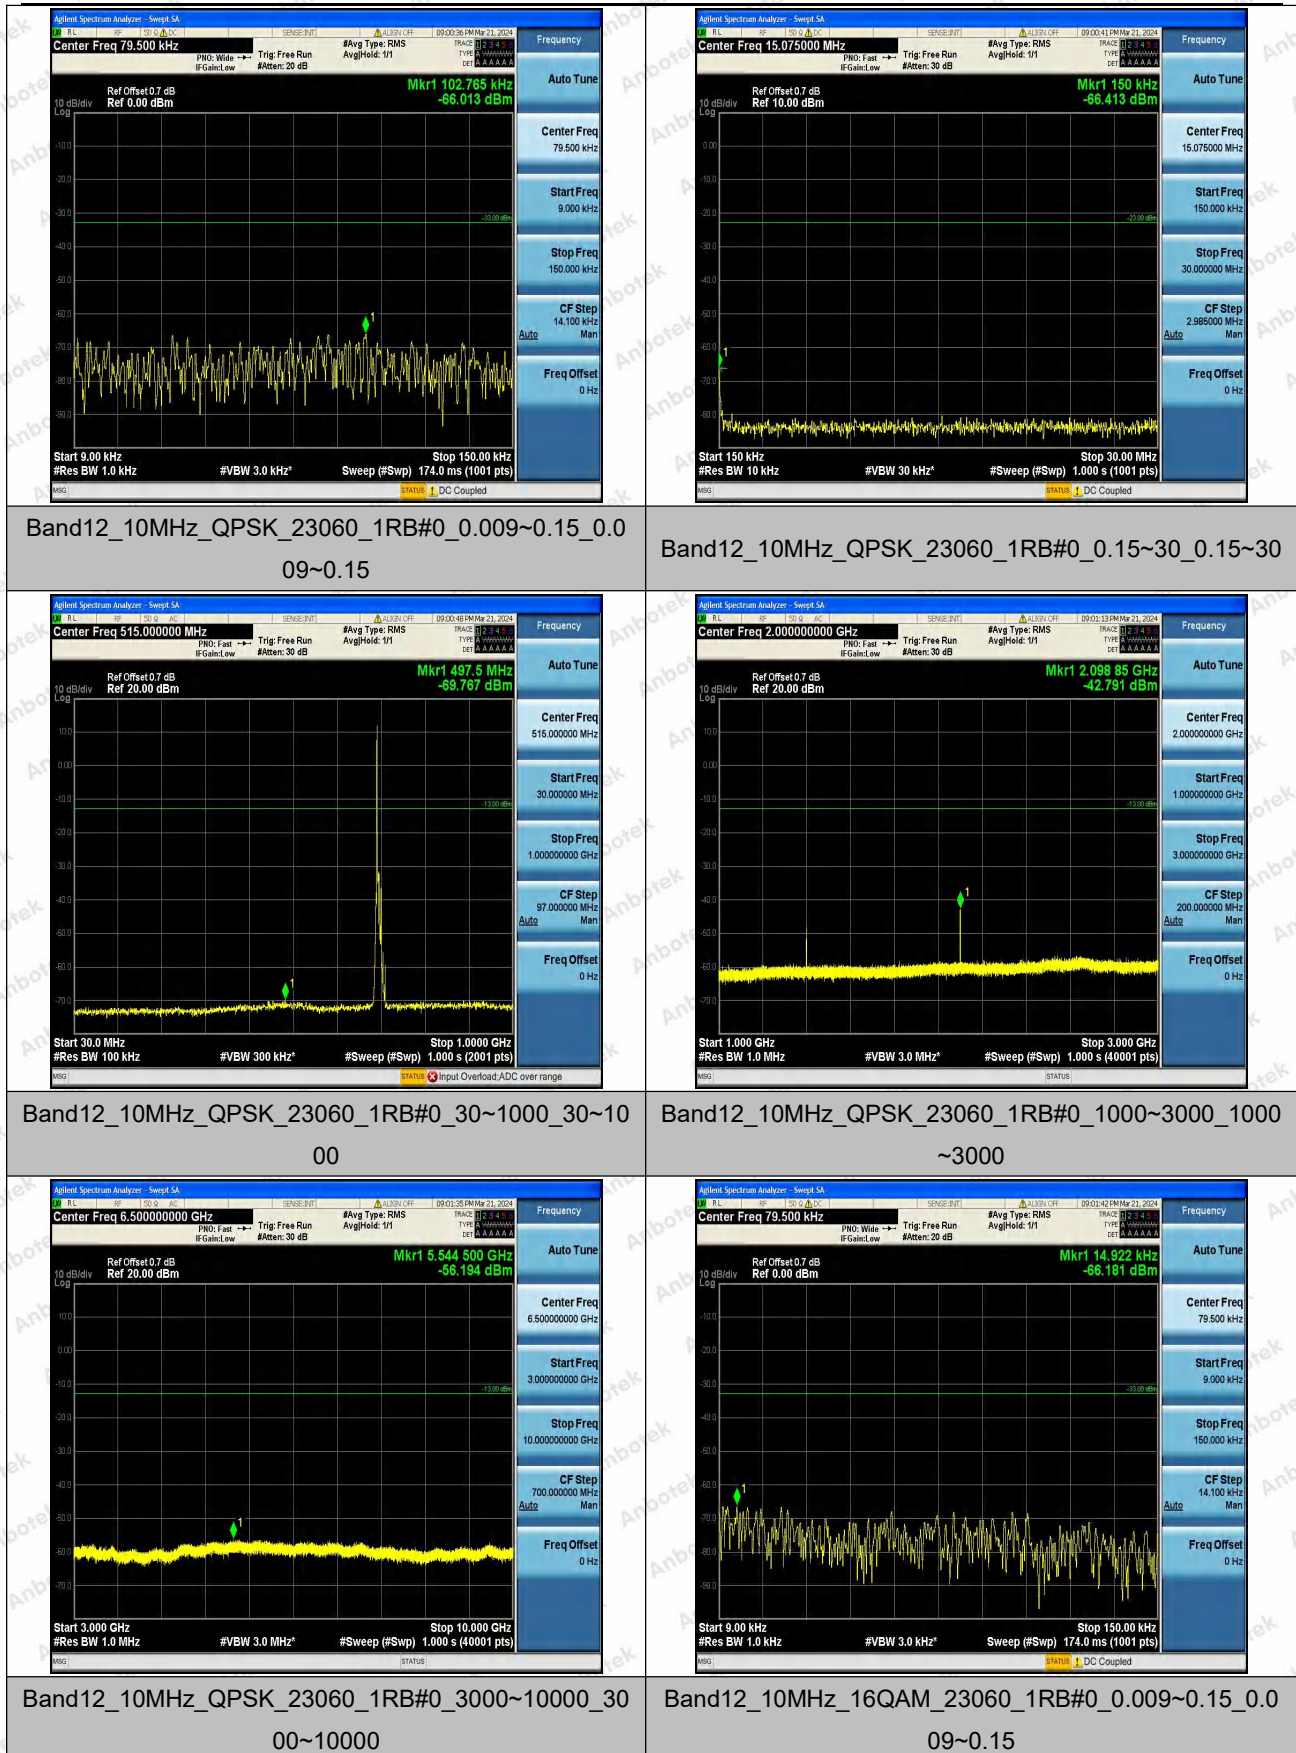

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline

400-003-0500

www.anbotek.com.cn



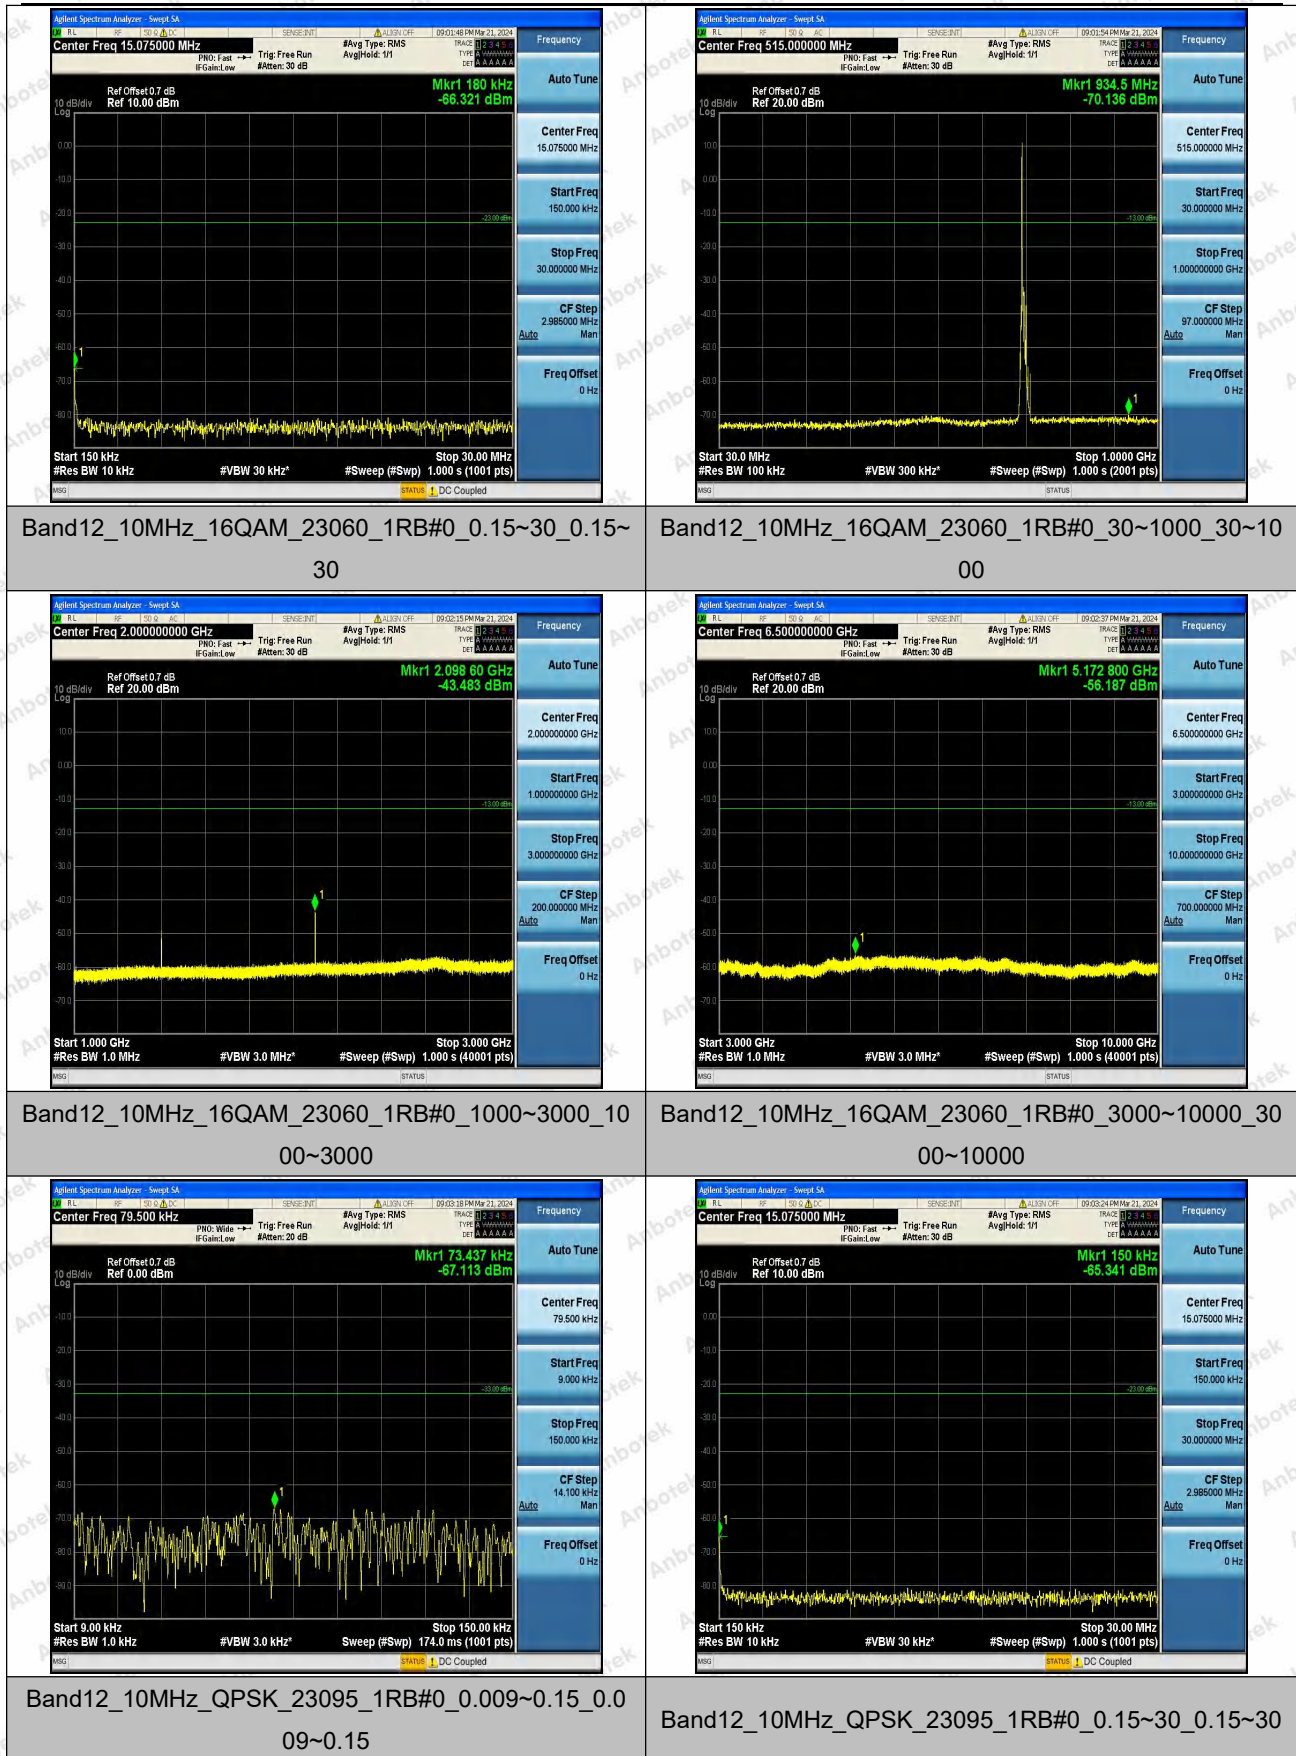

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline

400-003-0500

www.anbotek.com.cn



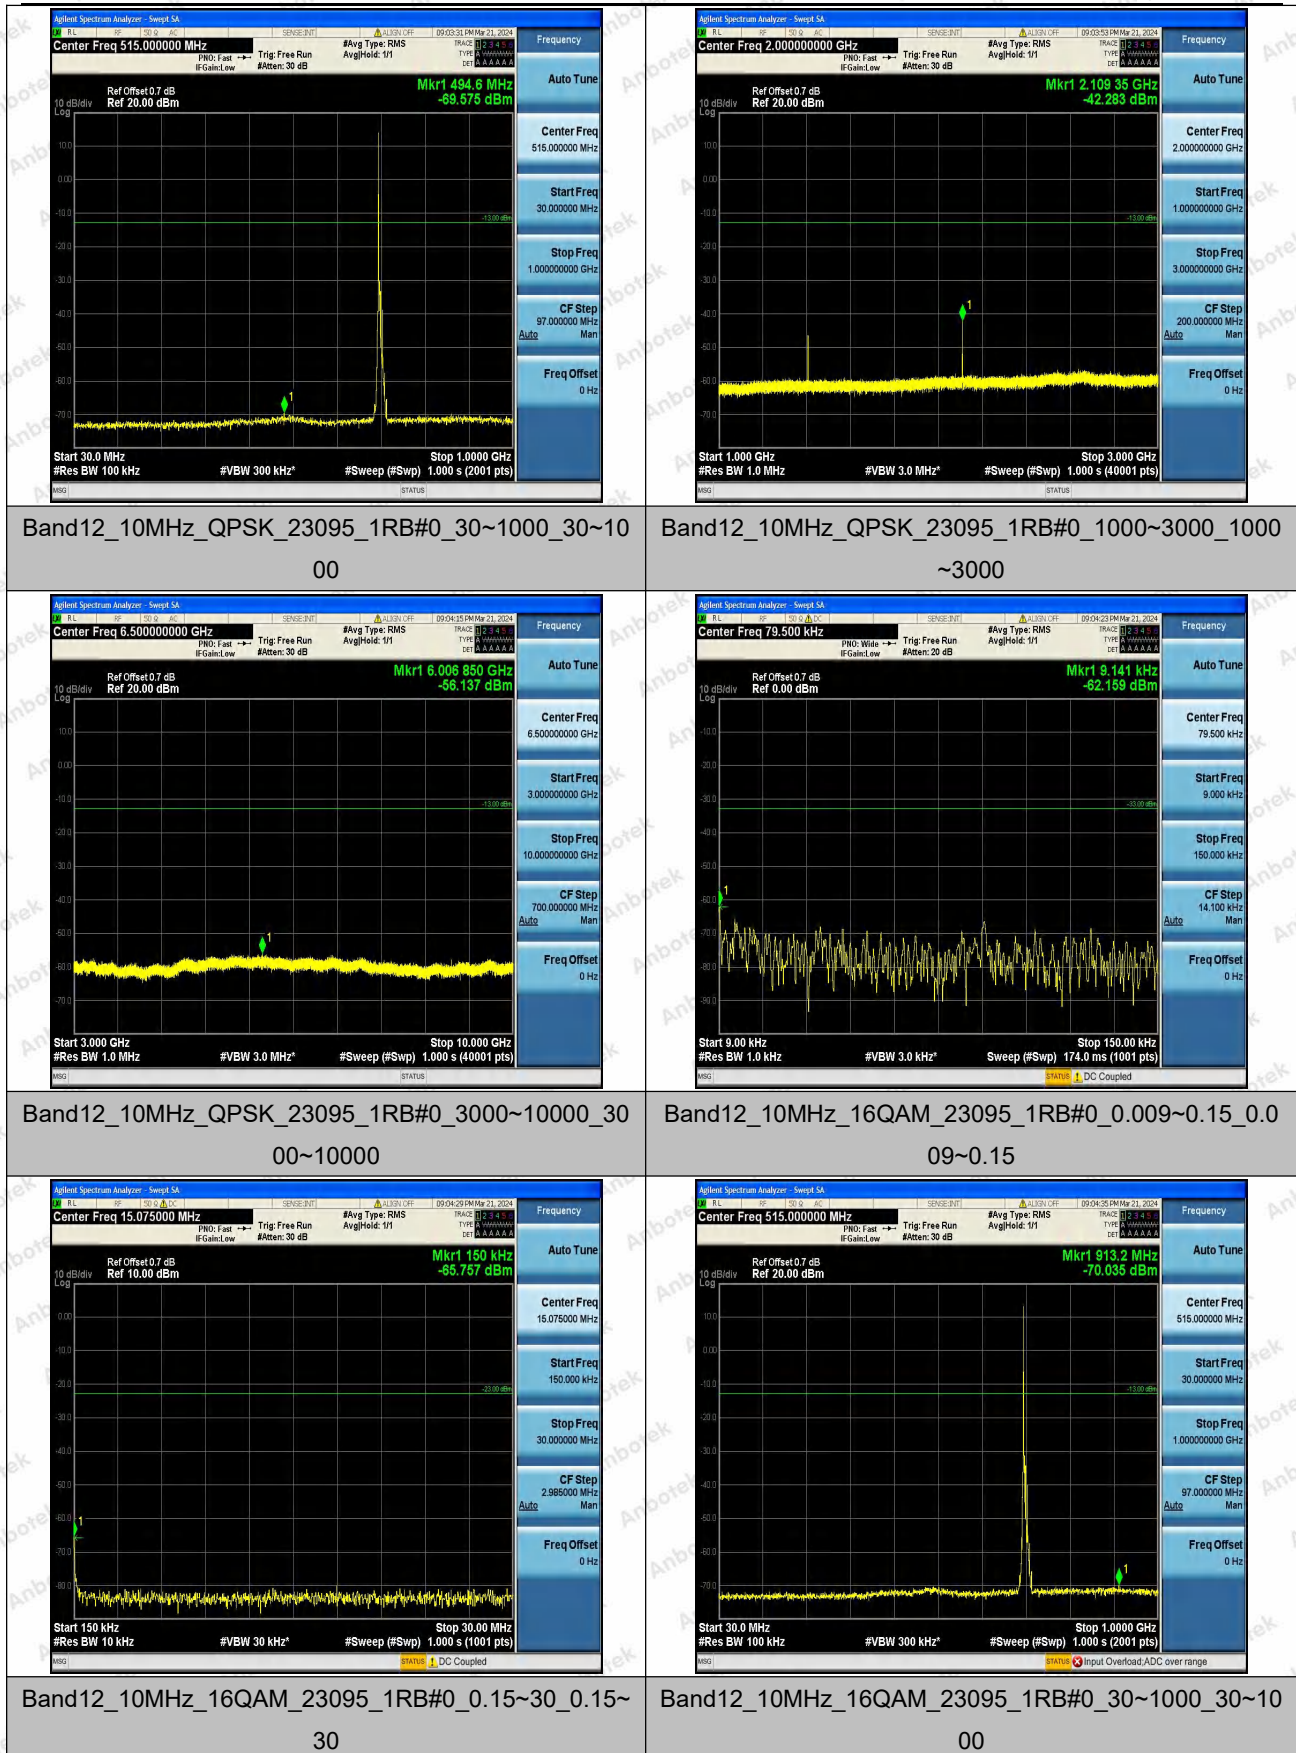


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com.cn




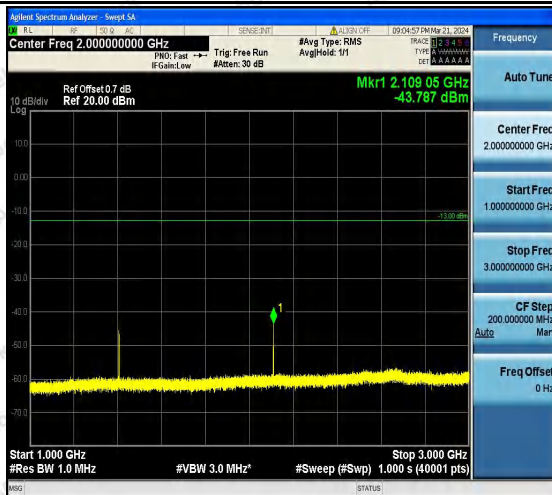


Band12_10MHz_16QAM_23095_1RB#0_1000~3000_10
00~3000

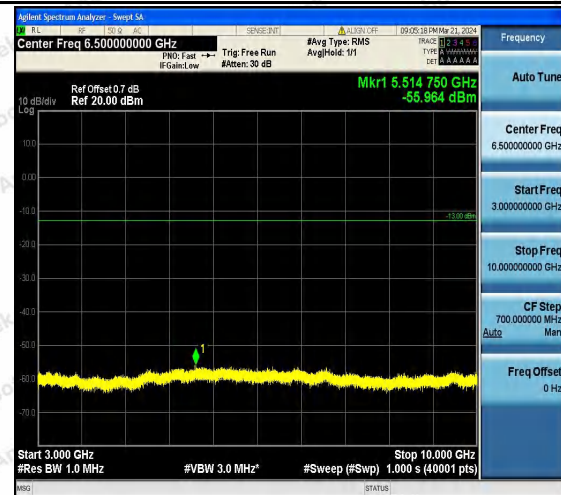


Band12_10MHz_16QAM_23095_1RB#0_3000~10000_30
00~10000

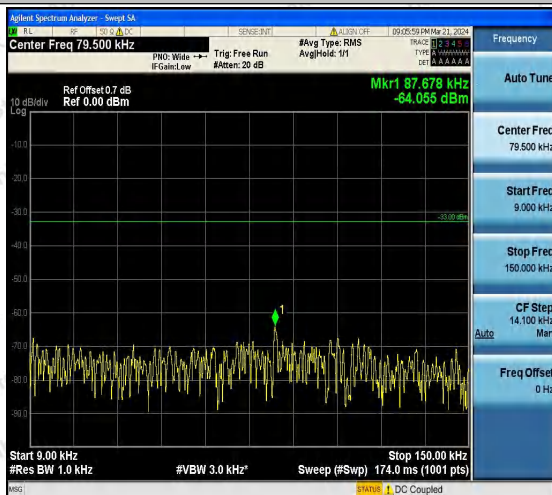


Band12_10MHz_QPSK_23130_1RB#0_0.009~0.15_0.0
09~0.15

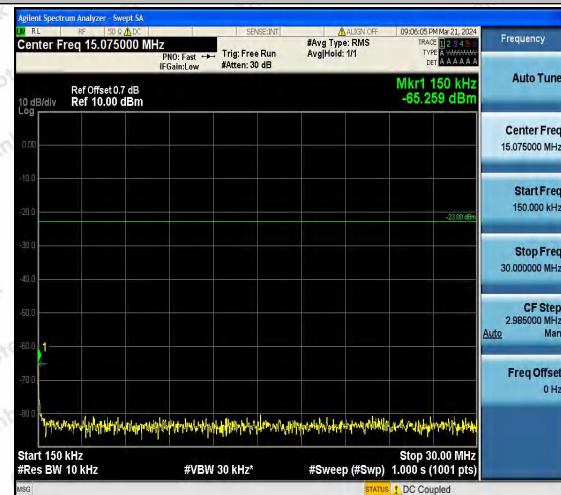

Band12_10MHz_QPSK_23130_1RB#0_0.15~30_0.15~30

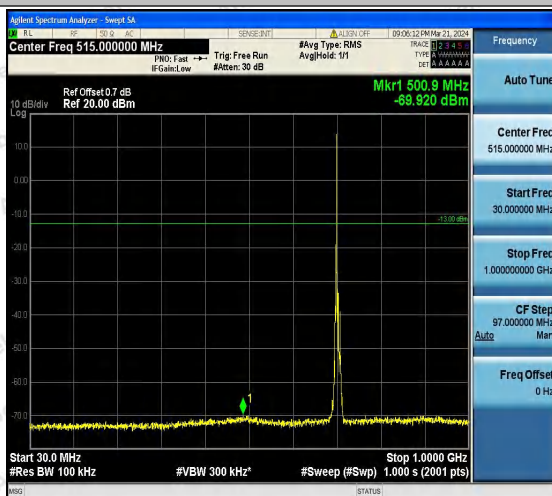


Band12_10MHz_QPSK_23130_1RB#0_30~1000_30~10
00

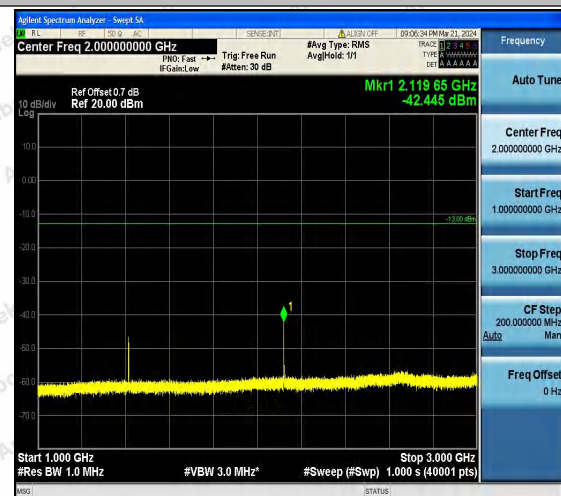

Band12_10MHz_QPSK_23130_1RB#0_1000~3000_1000
~3000



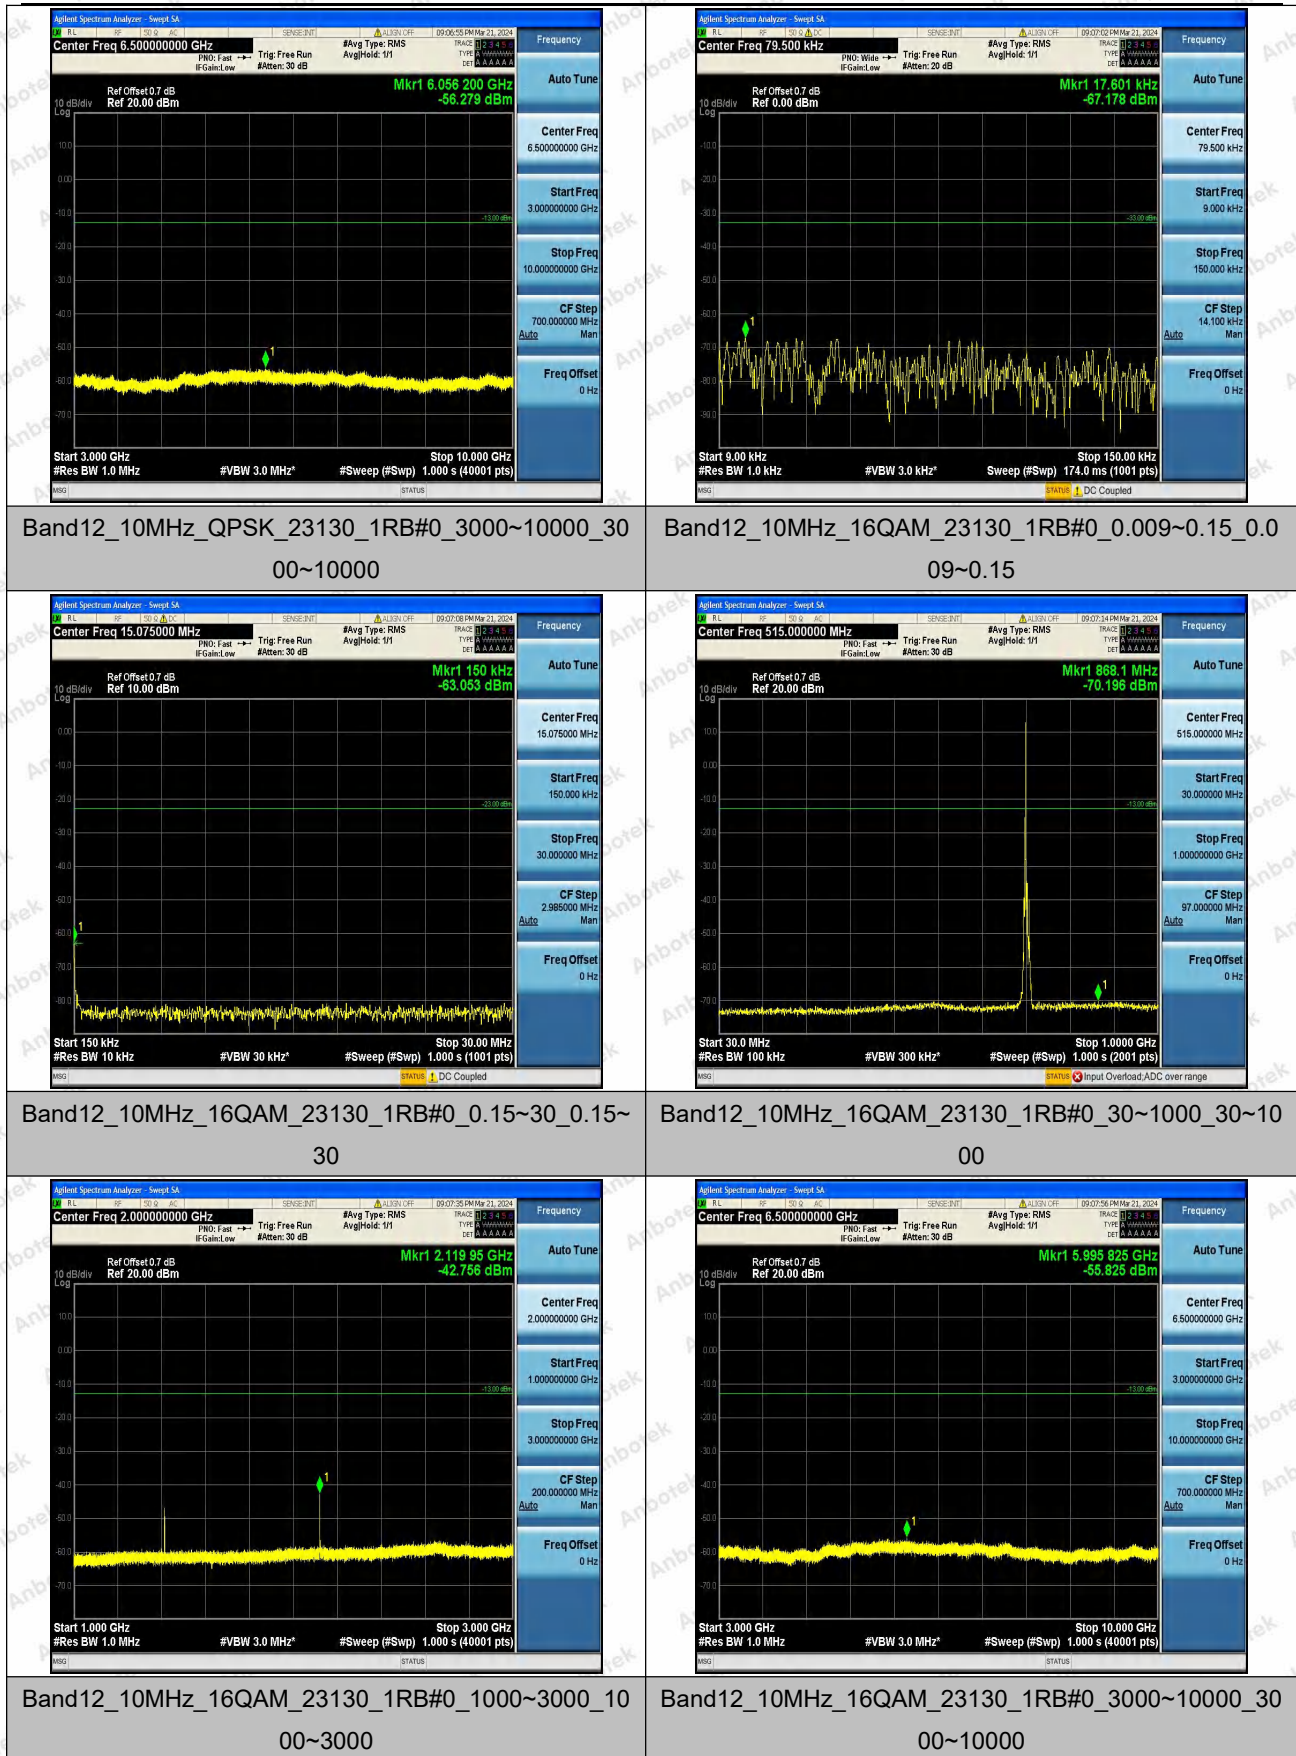

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band12	1.4MHz	QPSK	23017	6RB#0	VN	NT	-9.28	-0.013263	±2.5	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	VL	NT	-6.82	-0.009747	±2.5	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	VH	NT	-4.99	-0.007132	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	VN	NT	-2.65	-0.003787	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	VL	NT	-3.12	-0.004459	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	VH	NT	3.40	0.004859	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	VN	NT	-6.92	-0.009781	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	VL	NT	-5.26	-0.007435	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	VH	NT	-4.62	-0.006530	±2.5	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	VN	NT	-3.99	-0.005640	±2.5	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	VL	NT	2.39	0.003378	±2.5	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	VH	NT	-6.07	-0.008580	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	VN	NT	-5.25	-0.007340	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	VL	NT	-6.90	-0.009646	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	VH	NT	-5.48	-0.007661	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	VN	NT	-4.33	-0.006053	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	VL	NT	-4.36	-0.006095	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	VH	NT	-6.05	-0.008458	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	VN	NT	-4.39	-0.006267	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	VL	NT	-4.42	-0.006310	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	VH	NT	-4.63	-0.006610	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	VN	NT	3.09	0.004411	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	VL	NT	5.24	0.007480	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	VH	NT	3.25	0.004640	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	VN	NT	2.62	0.003703	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	VL	NT	-3.83	-0.005413	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	VH	NT	-5.81	-0.008212	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	VN	NT	-4.56	-0.006445	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	VL	NT	5.92	0.008367	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	VH	NT	1.80	0.002544	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	VN	NT	5.97	0.008355	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	VL	NT	-8.15	-0.011407	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	VH	NT	-7.12	-0.009965	±2.5	PASS
Band12	3MHz	16QAM	23165	15RB#0	VN	NT	-4.43	-0.006200	±2.5	PASS
Band12	3MHz	16QAM	23165	15RB#0	VL	NT	5.04	0.007054	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band12	3MHz	16QAM	23165	15RB#0	VH	NT	2.12	0.002967	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	VN	NT	-5.26	-0.007498	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	VL	NT	-3.49	-0.004975	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	VH	NT	-2.32	-0.003307	±2.5	PASS
Band12	5MHz	16QAM	23035	25RB#0	VN	NT	-3.59	-0.005118	±2.5	PASS
Band12	5MHz	16QAM	23035	25RB#0	VL	NT	3.55	0.005061	±2.5	PASS
Band12	5MHz	16QAM	23035	25RB#0	VH	NT	4.62	0.006586	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	VN	NT	4.52	0.006389	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	VL	NT	-5.55	-0.007845	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	VH	NT	-4.69	-0.006629	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	VN	NT	2.42	0.003420	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	VL	NT	4.85	0.006855	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	VH	NT	-2.57	-0.003633	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	VN	NT	-5.18	-0.007260	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	VL	NT	-4.59	-0.006433	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	VH	NT	-5.65	-0.007919	±2.5	PASS
Band12	5MHz	16QAM	23155	25RB#0	VN	NT	-4.55	-0.006377	±2.5	PASS
Band12	5MHz	16QAM	23155	25RB#0	VL	NT	3.65	0.005116	±2.5	PASS
Band12	5MHz	16QAM	23155	25RB#0	VH	NT	4.52	0.006335	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	VN	NT	-6.79	-0.009645	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	VL	NT	-8.30	-0.011790	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	VH	NT	-5.45	-0.007741	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	VN	NT	10.73	0.015166	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	VL	NT	-5.87	-0.008297	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	VH	NT	-3.88	-0.005484	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	VN	NT	4.84	0.006807	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	VL	NT	-5.38	-0.007567	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	VH	NT	-6.05	-0.008509	±2.5	PASS



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band12	1.4MHz	QPSK	23017	6RB#0	NV	-30	-4.95	-0.007074	±2.5	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	NV	-20	-5.28	-0.007546	±2.5	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	NV	-10	-5.81	-0.008304	±2.5	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	NV	0	-4.62	-0.006603	±2.5	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	NV	10	-7.75	-0.011076	±2.5	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	NV	20	-5.95	-0.008504	±2.5	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	NV	30	-5.14	-0.007346	±2.5	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	NV	40	-5.92	-0.008461	±2.5	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	NV	50	-7.51	-0.010733	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	NV	-30	-2.88	-0.004116	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	NV	-20	-3.82	-0.005459	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	NV	-10	-2.92	-0.004173	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	NV	0	-5.31	-0.007589	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	NV	10	-1.99	-0.002844	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	NV	20	-4.46	-0.006374	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	NV	30	2.12	0.003030	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	NV	40	-5.24	-0.007489	±2.5	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	NV	50	-2.37	-0.003387	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	-30	-5.38	-0.007604	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	-20	-8.55	-0.012085	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	-10	-3.76	-0.005314	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	0	-4.84	-0.006841	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	10	-3.92	-0.005541	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	20	-3.68	-0.005201	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	30	-3.92	-0.005541	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	40	-3.56	-0.005032	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	50	-4.98	-0.007039	±2.5	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	NV	-30	-7.75	-0.010954	±2.5	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	NV	-20	-2.49	-0.003519	±2.5	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	NV	-10	-5.84	-0.008254	±2.5	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	NV	0	-2.39	-0.003378	±2.5	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	NV	10	-6.62	-0.009357	±2.5	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	NV	20	-3.13	-0.004424	±2.5	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	NV	30	-2.60	-0.003675	±2.5	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	NV	40	-4.85	-0.006855	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band12	1.4MHz	16QAM	23095	6RB#0	NV	50	-6.19	-0.008749	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	NV	-30	-7.30	-0.010206	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	NV	-20	-5.92	-0.008276	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	NV	-10	-4.65	-0.006501	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	NV	0	-5.97	-0.008346	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	NV	10	-6.64	-0.009283	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	NV	20	-6.64	-0.009283	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	NV	30	-6.19	-0.008654	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	NV	40	-3.20	-0.004474	±2.5	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	NV	50	-4.92	-0.006878	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	NV	-30	-4.32	-0.006039	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	NV	-20	-4.96	-0.006934	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	NV	-10	-6.57	-0.009185	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	NV	0	-4.33	-0.006053	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	NV	10	-4.25	-0.005942	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	NV	20	-5.59	-0.007815	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	NV	30	-2.92	-0.004082	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	NV	40	-3.03	-0.004236	±2.5	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	NV	50	1.65	0.002307	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	NV	-30	-2.37	-0.003383	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	NV	-20	-3.72	-0.005310	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	NV	-10	-2.42	-0.003455	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	NV	0	-3.59	-0.005125	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	NV	10	2.22	0.003169	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	NV	20	1.33	0.001899	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	NV	30	-3.79	-0.005410	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	NV	40	2.59	0.003697	±2.5	PASS
Band12	3MHz	QPSK	23025	15RB#0	NV	50	2.86	0.004083	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	NV	-30	3.68	0.005253	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	NV	-20	-3.10	-0.004425	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	NV	-10	6.14	0.008765	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	NV	0	4.12	0.005882	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	NV	10	3.42	0.004882	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	NV	20	2.76	0.003940	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	NV	30	6.09	0.008694	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	NV	40	3.62	0.005168	±2.5	PASS
Band12	3MHz	16QAM	23025	15RB#0	NV	50	5.21	0.007438	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	-30	-5.21	-0.007364	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	-20	-3.68	-0.005201	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	-10	3.05	0.004311	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	0	-3.59	-0.005074	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band12	3MHz	QPSK	23095	15RB#0	NV	10	-3.55	-0.005018	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	20	-2.65	-0.003746	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	30	-2.45	-0.003463	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	40	-3.22	-0.004551	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	50	-3.95	-0.005583	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	NV	-30	6.38	0.009018	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	NV	-20	-2.17	-0.003067	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	NV	-10	-2.45	-0.003463	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	NV	0	-2.59	-0.003661	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	NV	10	5.12	0.007237	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	NV	20	3.60	0.005088	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	NV	30	4.41	0.006233	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	NV	40	-2.29	-0.003237	±2.5	PASS
Band12	3MHz	16QAM	23095	15RB#0	NV	50	4.19	0.005922	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	NV	-30	-4.39	-0.006144	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	NV	-20	-6.18	-0.008649	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	NV	-10	-2.55	-0.003569	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	NV	0	-5.15	-0.007208	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	NV	10	-5.46	-0.007642	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	NV	20	-7.98	-0.011169	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	NV	30	-3.33	-0.004661	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	NV	40	-4.43	-0.006200	±2.5	PASS
Band12	3MHz	QPSK	23165	15RB#0	NV	50	-2.98	-0.004171	±2.5	PASS
Band12	3MHz	16QAM	23165	15RB#0	NV	-30	3.88	0.005430	±2.5	PASS
Band12	3MHz	16QAM	23165	15RB#0	NV	-20	-3.76	-0.005262	±2.5	PASS
Band12	3MHz	16QAM	23165	15RB#0	NV	-10	3.50	0.004899	±2.5	PASS
Band12	3MHz	16QAM	23165	15RB#0	NV	0	-4.42	-0.006186	±2.5	PASS
Band12	3MHz	16QAM	23165	15RB#0	NV	10	-1.77	-0.002477	±2.5	PASS
Band12	3MHz	16QAM	23165	15RB#0	NV	20	2.98	0.004171	±2.5	PASS
Band12	3MHz	16QAM	23165	15RB#0	NV	30	2.33	0.003261	±2.5	PASS
Band12	3MHz	16QAM	23165	15RB#0	NV	40	2.26	0.003163	±2.5	PASS
Band12	3MHz	16QAM	23165	15RB#0	NV	50	3.98	0.005570	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	NV	-30	-4.75	-0.006771	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	NV	-20	-4.96	-0.007071	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	NV	-10	-3.88	-0.005531	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	NV	0	-1.73	-0.002466	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	NV	10	-2.72	-0.003877	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	NV	20	-3.89	-0.005545	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	NV	30	-1.36	-0.001939	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	NV	40	-4.16	-0.005930	±2.5	PASS
Band12	5MHz	QPSK	23035	25RB#0	NV	50	-2.17	-0.003093	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band12	5MHz	16QAM	23035	25RB#0	NV	-30	2.49	0.003550	±2.5	PASS
Band12	5MHz	16QAM	23035	25RB#0	NV	-20	4.62	0.006586	±2.5	PASS
Band12	5MHz	16QAM	23035	25RB#0	NV	-10	-2.89	-0.004120	±2.5	PASS
Band12	5MHz	16QAM	23035	25RB#0	NV	0	4.15	0.005916	±2.5	PASS
Band12	5MHz	16QAM	23035	25RB#0	NV	10	1.93	0.002751	±2.5	PASS
Band12	5MHz	16QAM	23035	25RB#0	NV	20	-4.29	-0.006115	±2.5	PASS
Band12	5MHz	16QAM	23035	25RB#0	NV	30	5.29	0.007541	±2.5	PASS
Band12	5MHz	16QAM	23035	25RB#0	NV	40	-3.35	-0.004775	±2.5	PASS
Band12	5MHz	16QAM	23035	25RB#0	NV	50	-2.57	-0.003664	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	-30	-5.38	-0.007604	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	-20	-5.62	-0.007943	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	-10	-2.90	-0.004099	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	0	-2.80	-0.003958	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	10	-4.72	-0.006671	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	20	-6.21	-0.008777	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	30	1.86	0.002629	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	40	1.43	0.002021	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	50	-5.01	-0.007081	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	NV	-30	3.29	0.004650	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	NV	-20	4.58	0.006473	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	NV	-10	2.79	0.003943	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	NV	0	2.73	0.003859	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	NV	10	4.12	0.005823	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	NV	20	-2.60	-0.003675	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	NV	30	4.18	0.005908	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	NV	40	2.15	0.003039	±2.5	PASS
Band12	5MHz	16QAM	23095	25RB#0	NV	50	2.75	0.003887	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	NV	-30	-7.64	-0.010708	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	NV	-20	-3.69	-0.005172	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	NV	-10	-1.66	-0.002327	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	NV	0	1.79	0.002509	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	NV	10	-3.06	-0.004289	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	NV	20	-4.28	-0.005999	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	NV	30	-5.06	-0.007092	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	NV	40	-5.16	-0.007232	±2.5	PASS
Band12	5MHz	QPSK	23155	25RB#0	NV	50	-2.45	-0.003434	±2.5	PASS
Band12	5MHz	16QAM	23155	25RB#0	NV	-30	6.75	0.009460	±2.5	PASS
Band12	5MHz	16QAM	23155	25RB#0	NV	-20	4.15	0.005816	±2.5	PASS
Band12	5MHz	16QAM	23155	25RB#0	NV	-10	5.14	0.007204	±2.5	PASS
Band12	5MHz	16QAM	23155	25RB#0	NV	0	-1.09	-0.001528	±2.5	PASS
Band12	5MHz	16QAM	23155	25RB#0	NV	10	2.47	0.003462	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band12	5MHz	16QAM	23155	25RB#0	NV	20	-1.82	-0.002551	±2.5	PASS
Band12	5MHz	16QAM	23155	25RB#0	NV	30	2.20	0.003083	±2.5	PASS
Band12	5MHz	16QAM	23155	25RB#0	NV	40	-2.20	-0.003083	±2.5	PASS
Band12	5MHz	16QAM	23155	25RB#0	NV	50	4.03	0.005648	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	NV	-30	-7.25	-0.010298	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	NV	-20	-4.69	-0.006662	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	NV	-10	-4.66	-0.006619	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	NV	0	-4.36	-0.006193	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	NV	10	-4.65	-0.006605	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	NV	20	-5.26	-0.007472	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	NV	30	-4.61	-0.006548	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	NV	40	-6.71	-0.009531	±2.5	PASS
Band12	10MHz	QPSK	23060	50RB#0	NV	50	-3.81	-0.005412	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	-30	-3.71	-0.005244	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	-20	-4.72	-0.006671	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	-10	-4.29	-0.006064	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	0	-5.62	-0.007943	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	10	-6.32	-0.008933	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	20	-5.35	-0.007562	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	30	-5.52	-0.007802	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	40	-2.40	-0.003392	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	50	-4.08	-0.005767	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	NV	-30	-5.74	-0.008073	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	NV	-20	-5.38	-0.007567	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	NV	-10	-3.25	-0.004571	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	NV	0	-6.32	-0.008889	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	NV	10	-4.28	-0.006020	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	NV	20	-3.76	-0.005288	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	NV	30	-3.92	-0.005513	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	NV	40	-2.53	-0.003558	±2.5	PASS
Band12	10MHz	QPSK	23130	50RB#0	NV	50	-6.48	-0.009114	±2.5	PASS

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn

