

## Appendix Test Data

|                  |                 |                    |             |
|------------------|-----------------|--------------------|-------------|
| Report No.:      | 18220WC40045605 | Test Sample No.:   | 1-2-2       |
| Start Test Date: | 2024.3.20       | Finish Test Date:  | 2024.4.3    |
| Test Engineer:   | Hayman Chen     | Auditor:           | Justin Feng |
| Temperature:     | 24.3℃           | Relative Humidity: | 57 %        |
| Pressure:        | 101 kPa         |                    |             |

## Appendix A: Conducted Output Power

### Test Result

| Band          | Bandwidth | Modulation | Channel | RB Configuration | Result(dBm) | Verdict |
|---------------|-----------|------------|---------|------------------|-------------|---------|
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 1RB#0            | 20.56       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 1RB#0            | 19.67       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 1RB#12           | 20.94       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 1RB#12           | 20.15       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 1RB#24           | 20.67       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 1RB#24           | 19.80       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 12RB#0           | 19.85       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 12RB#0           | 18.84       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 12RB#6           | 19.86       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 12RB#6           | 18.84       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 12RB#13          | 19.96       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 12RB#13          | 18.94       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 25RB#0           | 19.91       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 25RB#0           | 18.90       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 1RB#0            | 20.91       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 1RB#0            | 20.18       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 1RB#12           | 21.23       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 1RB#12           | 20.51       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 1RB#24           | 20.89       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 1RB#24           | 20.16       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 12RB#0           | 20.11       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 12RB#0           | 19.27       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 12RB#6           | 20.12       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 12RB#6           | 19.28       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 12RB#13          | 20.18       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 12RB#13          | 19.33       | PASS    |

### Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotech.com



Hotline  
400-003-0500  
www.anbotech.com.cn



|               |       |       |       |         |       |      |
|---------------|-------|-------|-------|---------|-------|------|
| 41(2535-2655) | 5MHz  | QPSK  | 40590 | 25RB#0  | 20.18 | PASS |
| 41(2535-2655) | 5MHz  | 16QAM | 40590 | 25RB#0  | 19.23 | PASS |
| 41(2535-2655) | 5MHz  | QPSK  | 41215 | 1RB#0   | 20.57 | PASS |
| 41(2535-2655) | 5MHz  | 16QAM | 41215 | 1RB#0   | 19.74 | PASS |
| 41(2535-2655) | 5MHz  | QPSK  | 41215 | 1RB#12  | 21.00 | PASS |
| 41(2535-2655) | 5MHz  | 16QAM | 41215 | 1RB#12  | 20.17 | PASS |
| 41(2535-2655) | 5MHz  | QPSK  | 41215 | 1RB#24  | 20.70 | PASS |
| 41(2535-2655) | 5MHz  | 16QAM | 41215 | 1RB#24  | 19.87 | PASS |
| 41(2535-2655) | 5MHz  | QPSK  | 41215 | 12RB#0  | 19.90 | PASS |
| 41(2535-2655) | 5MHz  | 16QAM | 41215 | 12RB#0  | 18.91 | PASS |
| 41(2535-2655) | 5MHz  | QPSK  | 41215 | 12RB#6  | 19.90 | PASS |
| 41(2535-2655) | 5MHz  | 16QAM | 41215 | 12RB#6  | 18.91 | PASS |
| 41(2535-2655) | 5MHz  | QPSK  | 41215 | 12RB#13 | 19.99 | PASS |
| 41(2535-2655) | 5MHz  | 16QAM | 41215 | 12RB#13 | 19.01 | PASS |
| 41(2535-2655) | 5MHz  | QPSK  | 41215 | 25RB#0  | 19.95 | PASS |
| 41(2535-2655) | 5MHz  | 16QAM | 41215 | 25RB#0  | 18.98 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40090 | 1RB#0   | 20.34 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40090 | 1RB#0   | 19.19 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40090 | 1RB#24  | 21.08 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40090 | 1RB#24  | 19.81 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40090 | 1RB#49  | 20.81 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40090 | 1RB#49  | 19.52 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40090 | 25RB#0  | 19.88 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40090 | 25RB#0  | 18.80 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40090 | 25RB#12 | 19.89 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40090 | 25RB#12 | 18.82 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40090 | 25RB#25 | 19.94 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40090 | 25RB#25 | 18.88 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40590 | 1RB#0   | 20.76 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40590 | 1RB#0   | 19.92 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40590 | 1RB#24  | 21.28 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40590 | 1RB#24  | 20.44 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40590 | 1RB#49  | 20.81 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40590 | 1RB#49  | 20.04 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40590 | 25RB#0  | 20.10 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40590 | 25RB#0  | 19.13 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40590 | 25RB#12 | 20.12 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40590 | 25RB#12 | 19.14 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40590 | 25RB#25 | 20.15 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40590 | 25RB#25 | 19.29 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 41190 | 1RB#0   | 20.26 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 41190 | 1RB#0   | 19.06 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



|               |       |       |       |         |       |      |
|---------------|-------|-------|-------|---------|-------|------|
| 41(2535-2655) | 10MHz | QPSK  | 41190 | 1RB#24  | 20.96 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 41190 | 1RB#24  | 19.65 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 41190 | 1RB#49  | 20.67 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 41190 | 1RB#49  | 19.36 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 41190 | 25RB#0  | 19.72 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 41190 | 25RB#0  | 18.66 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 41190 | 25RB#12 | 19.73 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 41190 | 25RB#12 | 18.68 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 41190 | 25RB#25 | 19.88 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 41190 | 25RB#25 | 18.84 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40090 | 50RB#0  | 20.00 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 40590 | 50RB#0  | 20.21 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 41190 | 50RB#0  | 19.85 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40115 | 1RB#0   | 20.74 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40115 | 1RB#0   | 20.06 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40115 | 1RB#38  | 21.11 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40115 | 1RB#38  | 20.45 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40115 | 1RB#74  | 21.08 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40115 | 1RB#74  | 20.41 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40115 | 38RB#0  | 19.98 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40115 | 38RB#0  | 19.98 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40115 | 38RB#18 | 19.99 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40115 | 38RB#18 | 19.99 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40115 | 38RB#37 | 19.98 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40115 | 38RB#37 | 19.98 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40590 | 1RB#0   | 21.17 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40590 | 1RB#0   | 20.20 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40590 | 1RB#38  | 21.33 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40590 | 1RB#38  | 20.36 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40590 | 1RB#74  | 21.25 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40590 | 1RB#74  | 20.25 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40590 | 38RB#0  | 20.21 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40590 | 38RB#0  | 20.20 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40590 | 38RB#18 | 20.21 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40590 | 38RB#18 | 20.20 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40590 | 38RB#37 | 20.20 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40590 | 38RB#37 | 20.20 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 41165 | 1RB#0   | 20.67 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 41165 | 1RB#0   | 19.92 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 41165 | 1RB#38  | 21.00 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 41165 | 1RB#38  | 20.21 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 41165 | 1RB#74  | 21.00 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



|               |       |       |       |         |       |      |
|---------------|-------|-------|-------|---------|-------|------|
| 41(2535-2655) | 15MHz | 16QAM | 41165 | 1RB#74  | 20.23 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 41165 | 38RB#0  | 19.82 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 41165 | 38RB#0  | 19.82 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 41165 | 38RB#18 | 19.82 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 41165 | 38RB#18 | 19.82 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 41165 | 38RB#37 | 19.82 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 41165 | 38RB#37 | 19.82 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40115 | 75RB#0  | 20.04 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40590 | 75RB#0  | 20.22 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 41165 | 75RB#0  | 19.79 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 1RB#0   | 20.49 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40140 | 1RB#0   | 19.77 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 1RB#49  | 21.23 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40140 | 1RB#49  | 20.55 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 1RB#99  | 20.95 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40140 | 1RB#99  | 20.26 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 50RB#0  | 19.94 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40140 | 50RB#0  | 20.96 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 50RB#25 | 19.99 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40140 | 50RB#25 | 20.95 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 50RB#50 | 20.30 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40140 | 50RB#50 | 20.96 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40590 | 1RB#0   | 20.81 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40590 | 1RB#0   | 19.70 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40590 | 1RB#49  | 21.33 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40590 | 1RB#49  | 20.21 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40590 | 1RB#99  | 20.92 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40590 | 1RB#99  | 19.77 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40590 | 50RB#0  | 20.12 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40590 | 50RB#0  | 21.15 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40590 | 50RB#25 | 20.20 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40590 | 50RB#25 | 21.16 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40590 | 50RB#50 | 20.26 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40590 | 50RB#50 | 21.16 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 1RB#0   | 20.45 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 1RB#0   | 19.68 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 1RB#49  | 21.06 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 1RB#49  | 20.15 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 1RB#99  | 20.83 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 1RB#99  | 19.93 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 50RB#0  | 19.69 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 50RB#0  | 21.07 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



|               |       |       |       |         |       |      |
|---------------|-------|-------|-------|---------|-------|------|
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 50RB#25 | 19.71 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 50RB#25 | 21.08 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 50RB#50 | 19.91 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 50RB#50 | 21.08 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 100RB#0 | 20.18 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40590 | 100RB#0 | 20.20 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 100RB#0 | 19.85 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn




## Appendix B: Peak-to-Average Ratio(CCDF)

### Test Result

| Band          | Bandwidth | Modulation | Channel | RB Configuration | Result(dB) | Limit(dB) | Verdict |
|---------------|-----------|------------|---------|------------------|------------|-----------|---------|
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 1RB#0            | 7.66       | 13        | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 1RB#0            | 8.91       | 13        | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 25RB#0           | 8.36       | 13        | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 25RB#0           | 9.29       | 13        | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 1RB#0            | 7.64       | 13        | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 1RB#0            | 9.17       | 13        | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 25RB#0           | 8.36       | 13        | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 25RB#0           | 9.51       | 13        | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 41215   | 1RB#0            | 7.93       | 13        | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 41215   | 1RB#0            | 8.68       | 13        | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 41215   | 25RB#0           | 8.35       | 13        | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 41215   | 25RB#0           | 9.05       | 13        | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40090   | 1RB#0            | 8.08       | 13        | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 40090   | 1RB#0            | 8.92       | 13        | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40590   | 1RB#0            | 7.66       | 13        | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 40590   | 1RB#0            | 8.27       | 13        | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 41190   | 1RB#0            | 8.22       | 13        | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 41190   | 1RB#0            | 8.78       | 13        | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40090   | 50RB#0           | 8.30       | 13        | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40590   | 50RB#0           | 8.36       | 13        | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 41190   | 50RB#0           | 8.54       | 13        | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 40115   | 1RB#0            | 8.21       | 13        | PASS    |
| 41(2535-2655) | 15MHz     | 16QAM      | 40115   | 1RB#0            | 9.19       | 13        | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 40590   | 1RB#0            | 7.10       | 13        | PASS    |
| 41(2535-2655) | 15MHz     | 16QAM      | 40590   | 1RB#0            | 8.76       | 13        | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 41165   | 1RB#0            | 7.75       | 13        | PASS    |
| 41(2535-2655) | 15MHz     | 16QAM      | 41165   | 1RB#0            | 8.81       | 13        | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 40115   | 75RB#0           | 8.63       | 13        | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 40590   | 75RB#0           | 8.92       | 13        | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 41165   | 75RB#0           | 8.83       | 13        | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 40140   | 1RB#0            | 8.03       | 13        | PASS    |
| 41(2535-2655) | 20MHz     | 16QAM      | 40140   | 1RB#0            | 8.69       | 13        | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 40590   | 1RB#0            | 7.90       | 13        | PASS    |
| 41(2535-2655) | 20MHz     | 16QAM      | 40590   | 1RB#0            | 8.51       | 13        | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 41140   | 1RB#0            | 8.14       | 13        | PASS    |
| 41(2535-2655) | 20MHz     | 16QAM      | 41140   | 1RB#0            | 9.17       | 13        | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 40140   | 100RB#0          | 8.76       | 13        | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 40590   | 100RB#0          | 9.01       | 13        | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 41140   | 100RB#0          | 9.09       | 13        | PASS    |



## Test Graphs

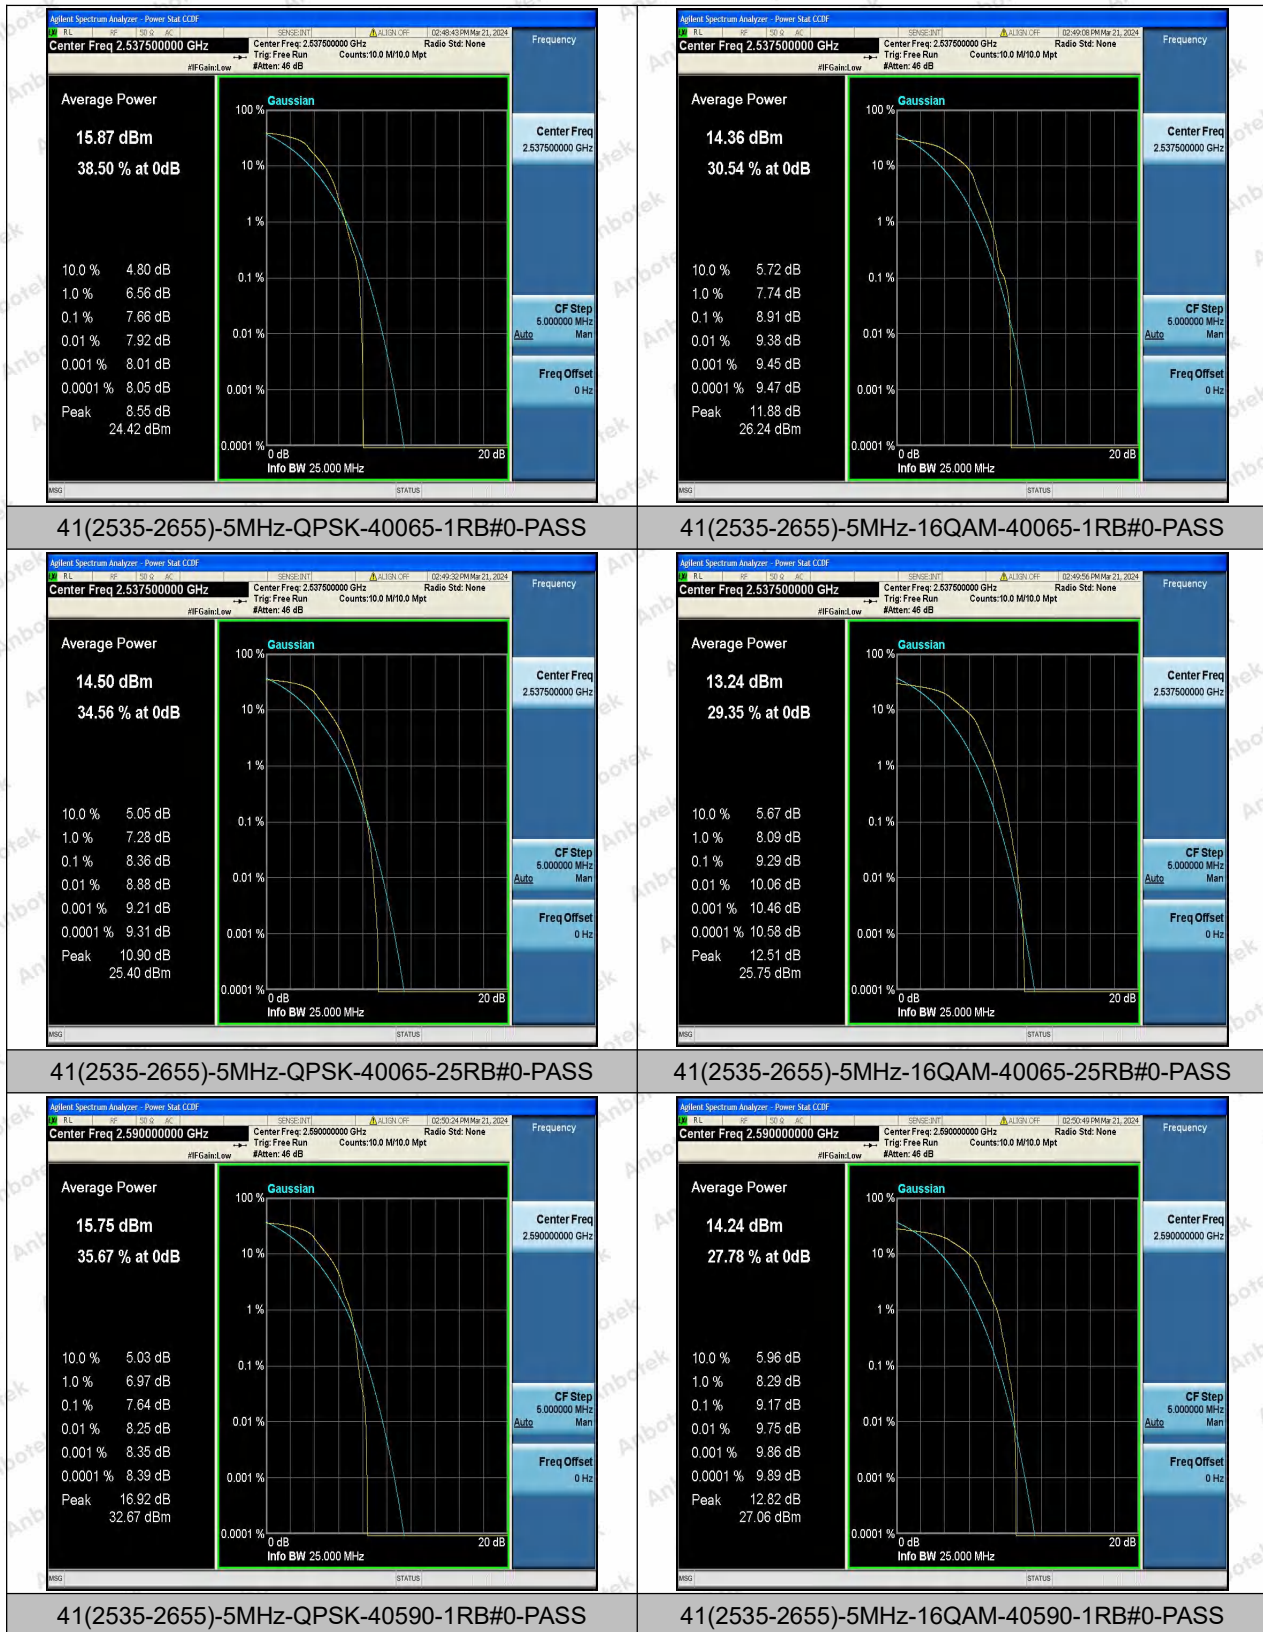


## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com





Hotline  
 400-003-0500  
 www.anbotek.com.cn




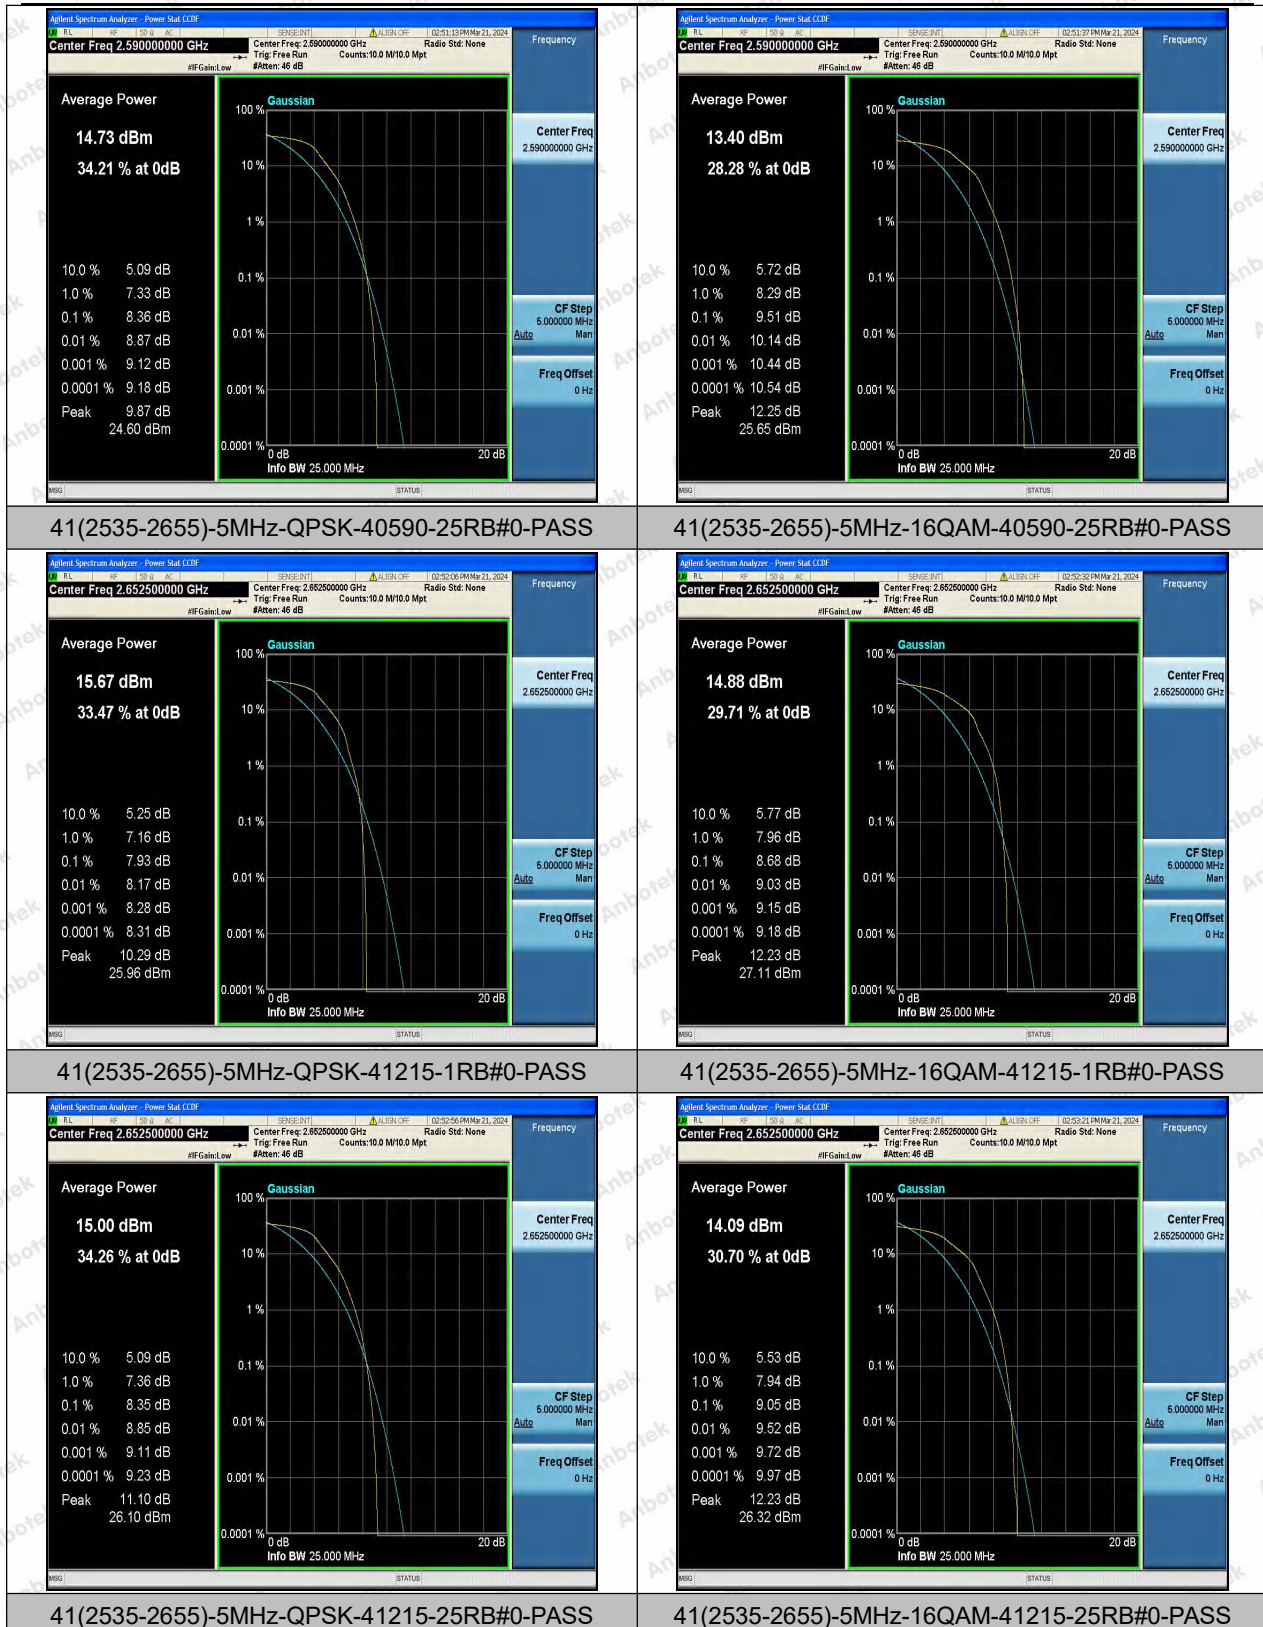


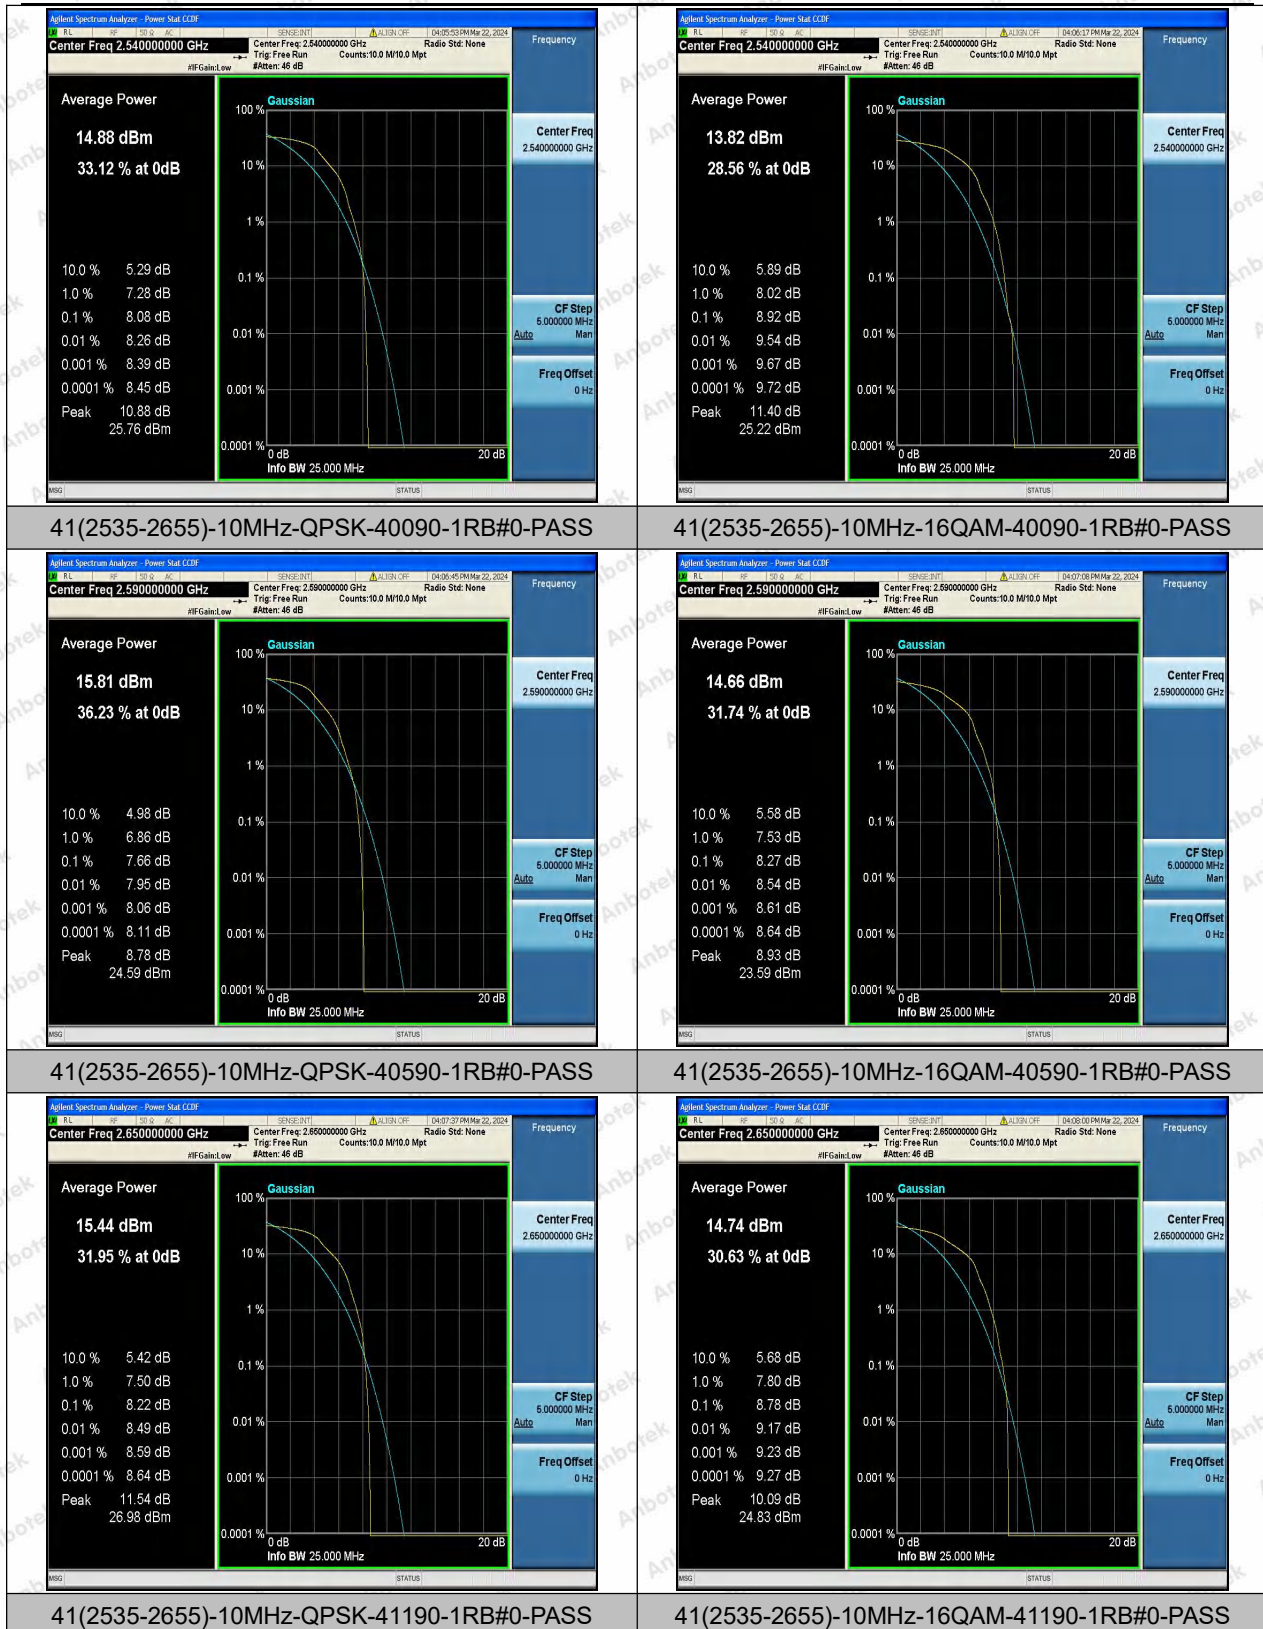

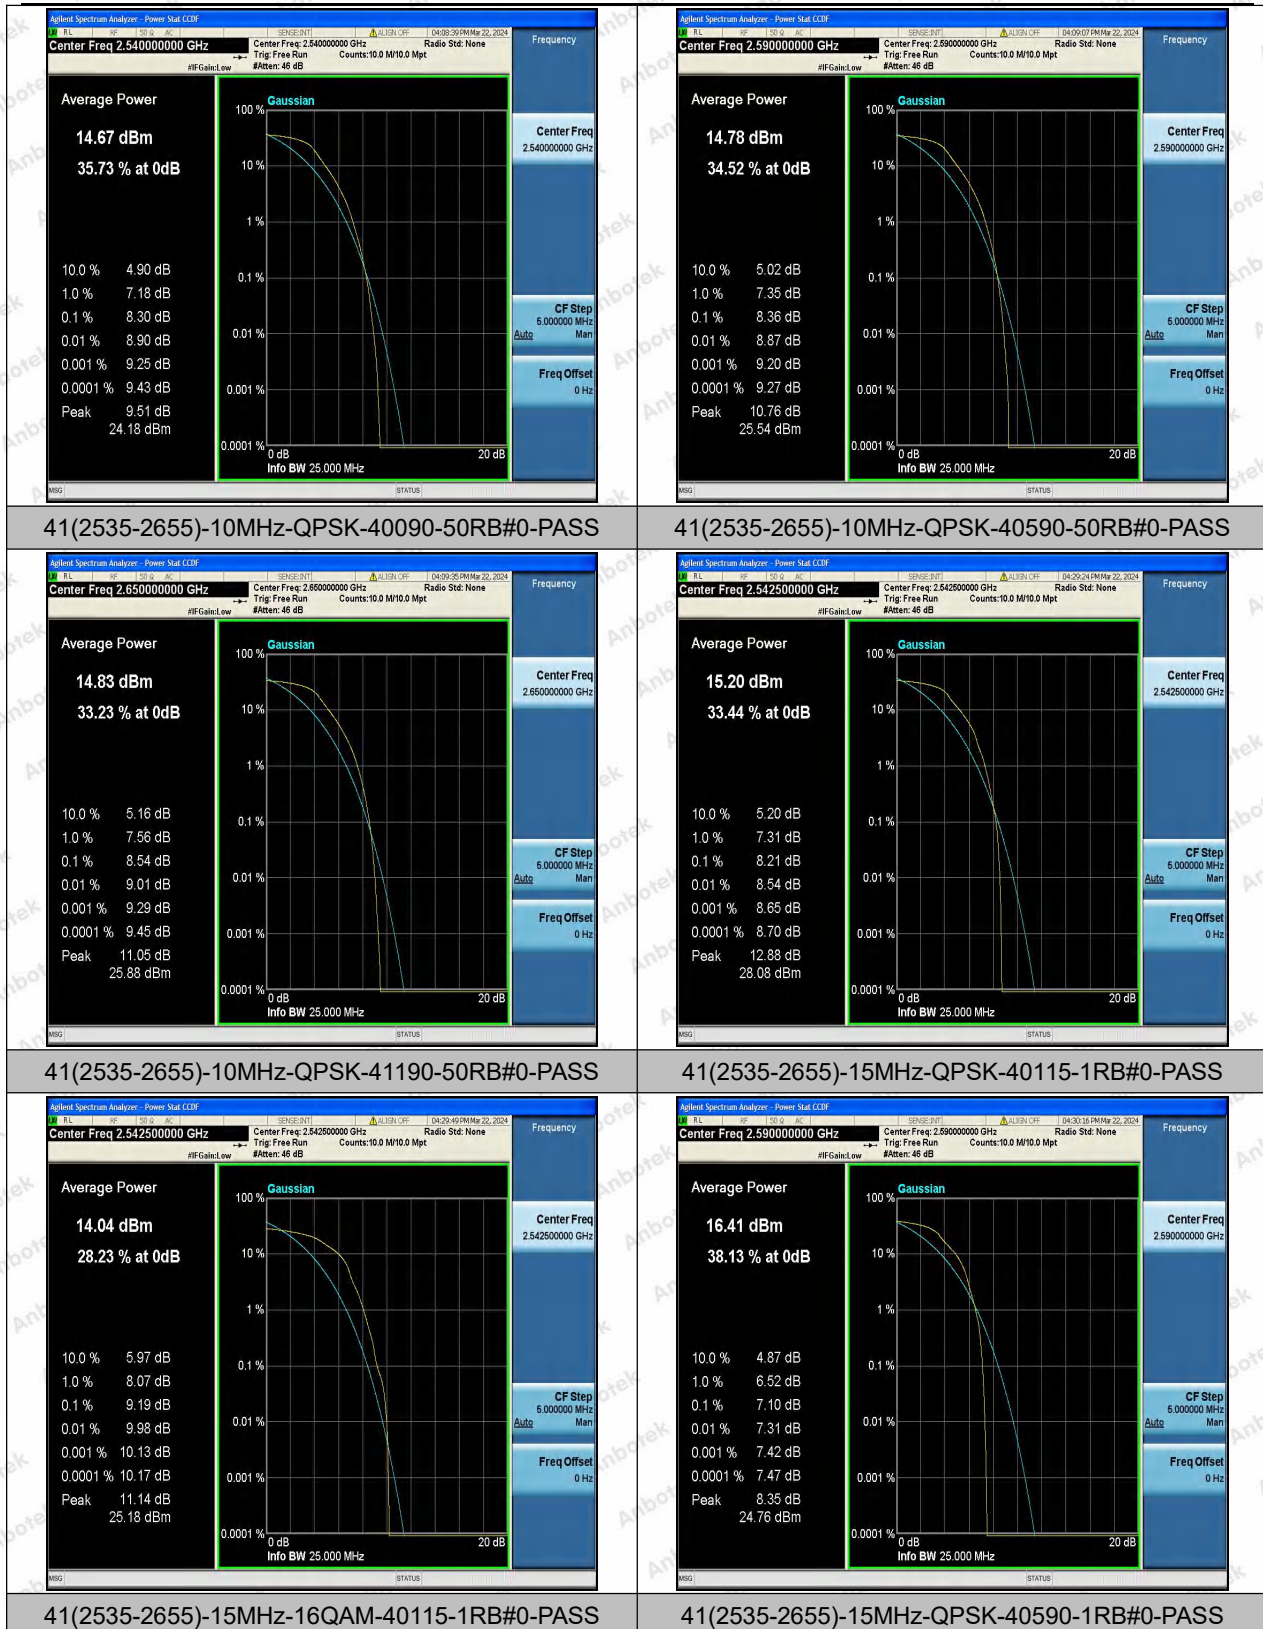

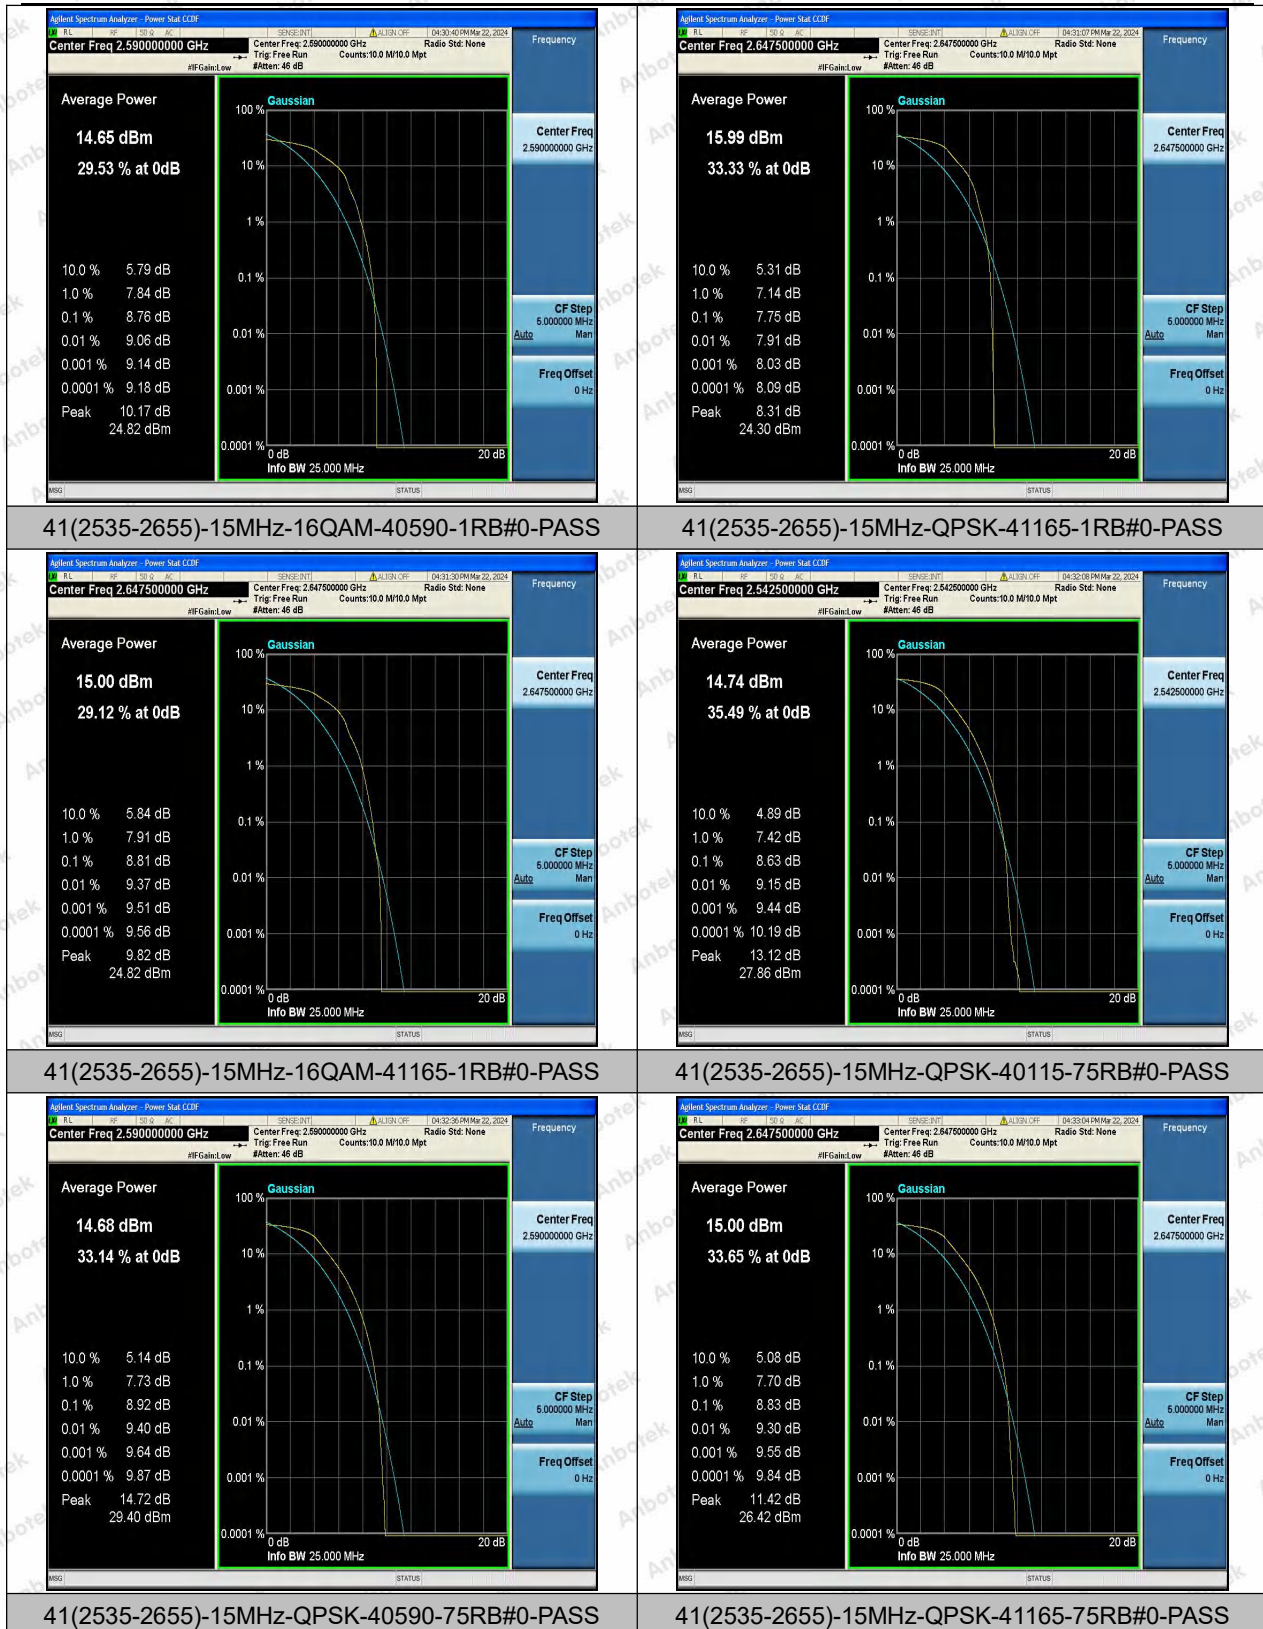

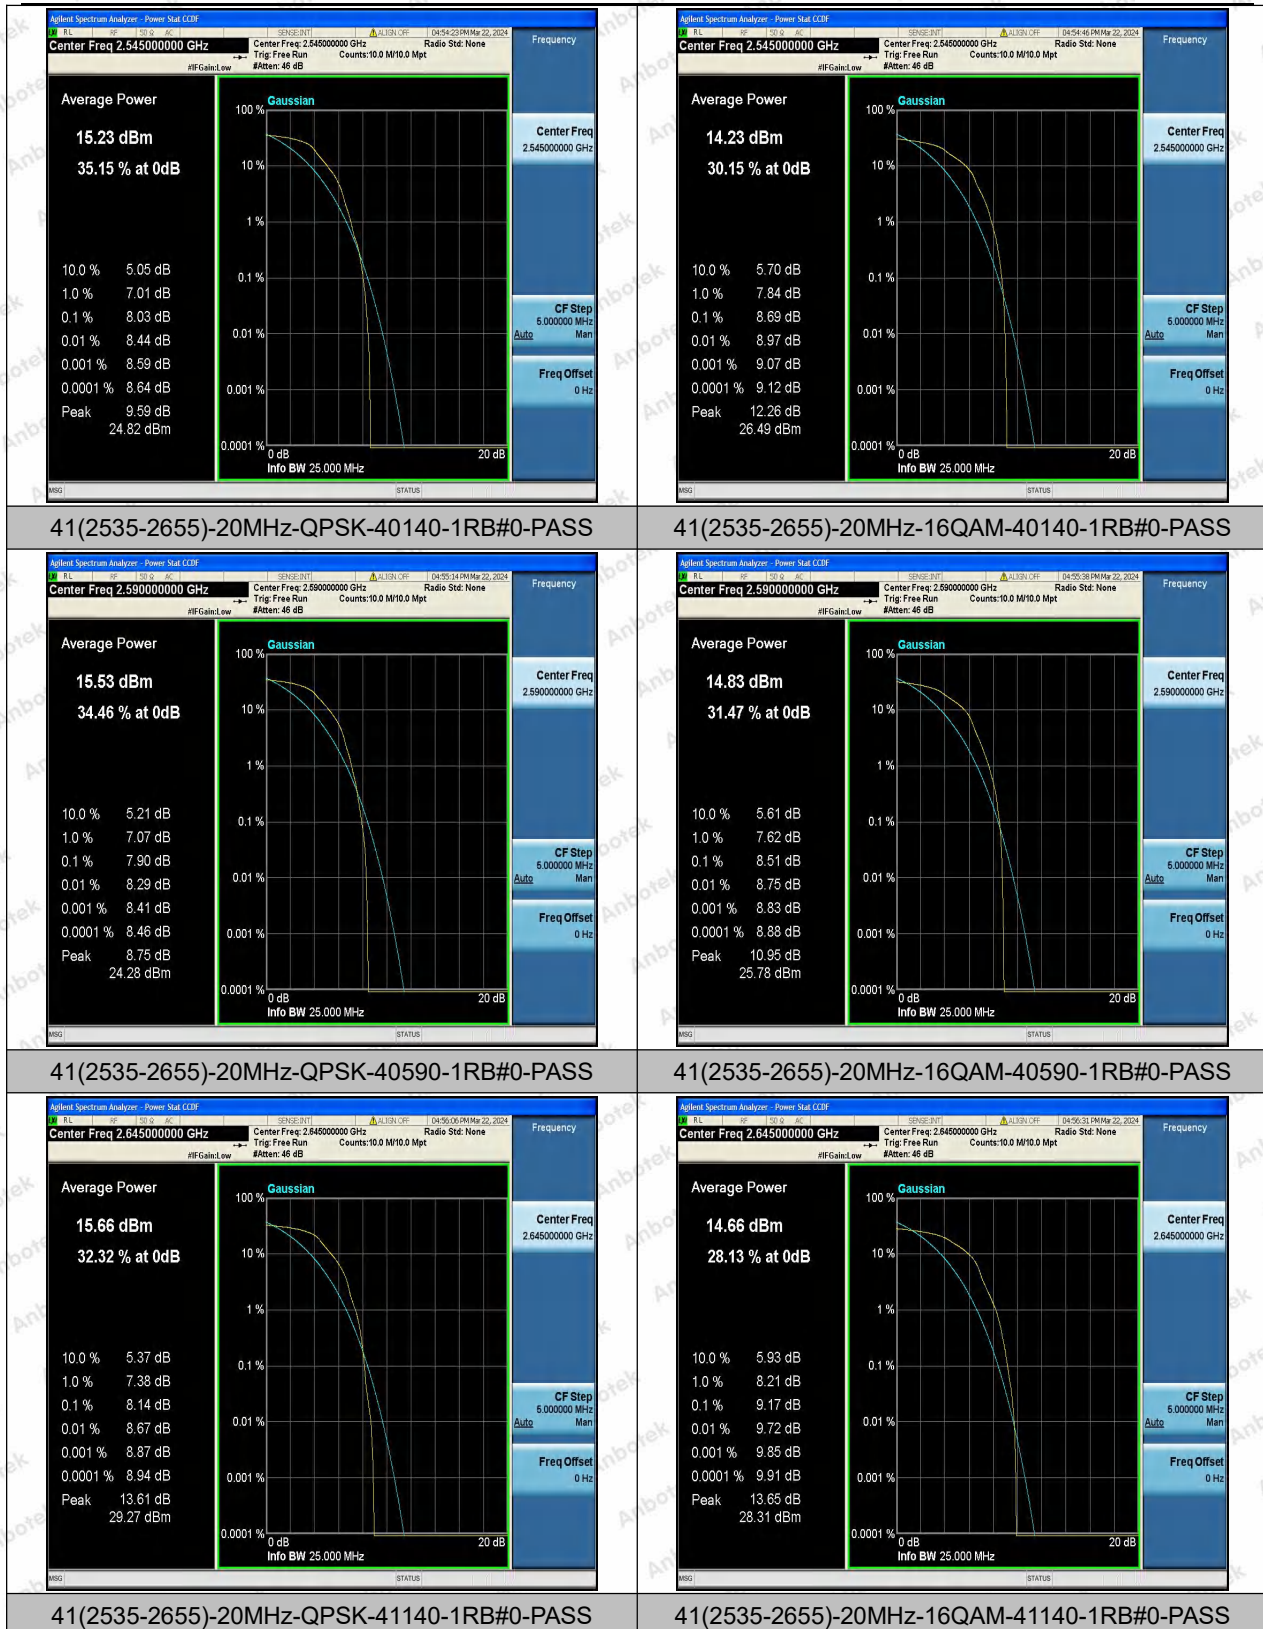

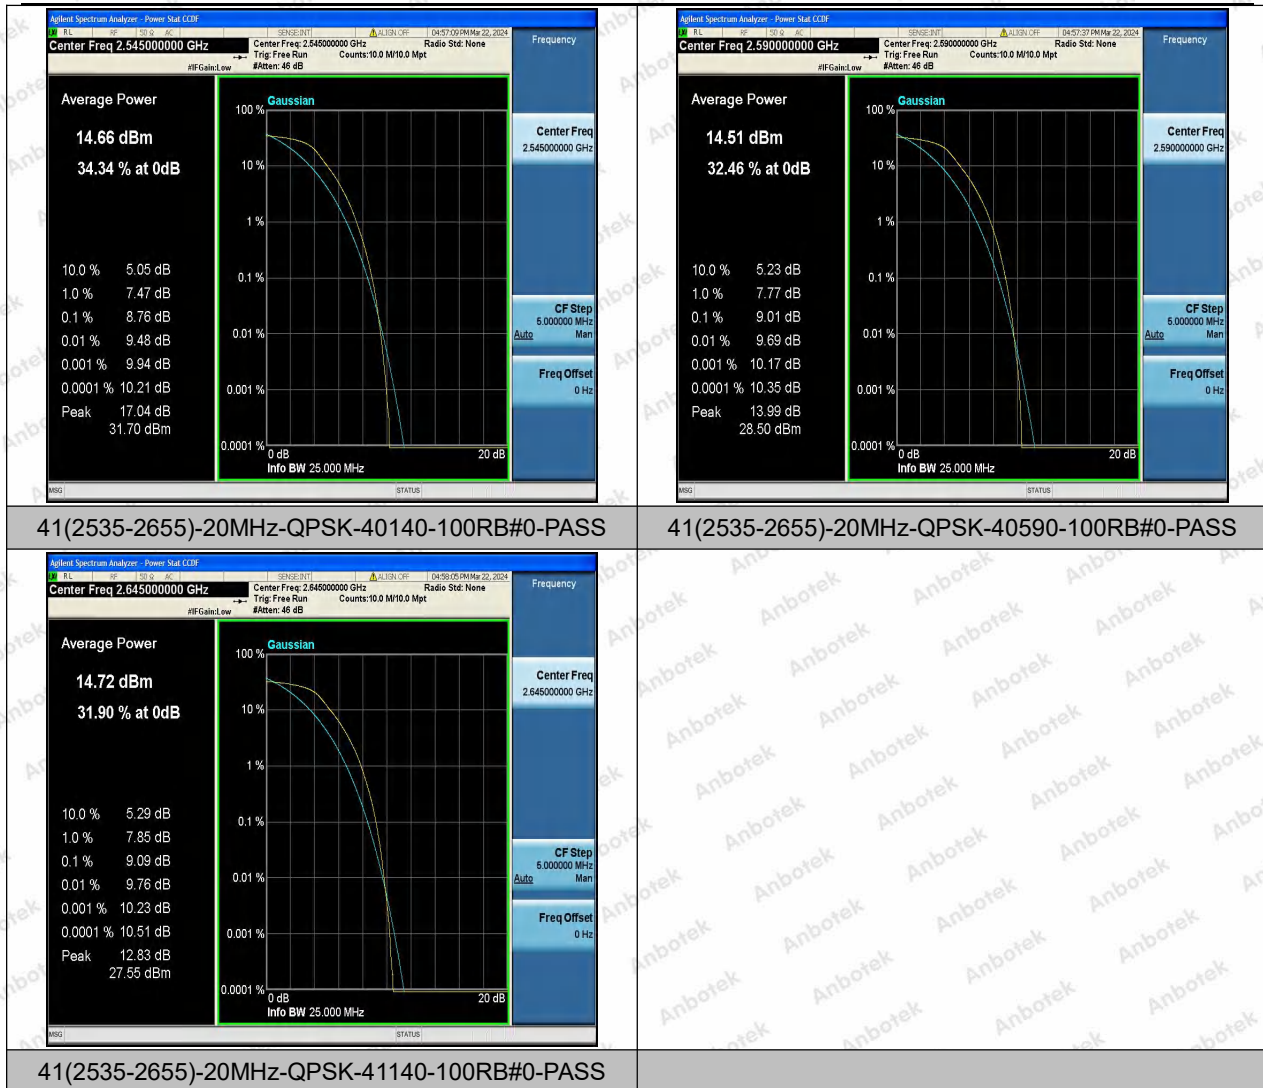


## Appendix C: 26dB Bandwidth and Occupied Bandwidth

### Test Result

| Band          | Bandwidth | Modulation | Channel | RB Configuration | Occupied Bandwidth (MHz) | 26dB Bandwidth (MHz) | Verdict |
|---------------|-----------|------------|---------|------------------|--------------------------|----------------------|---------|
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 25RB#0           | 4.4927                   | 5.054                | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 25RB#0           | 4.4950                   | 5.061                | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 25RB#0           | 4.5067                   | 5.075                | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 25RB#0           | 4.4929                   | 5.029                | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 41215   | 25RB#0           | 4.4911                   | 5.009                | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 41215   | 25RB#0           | 4.5029                   | 4.972                | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40090   | 50RB#0           | 8.9748                   | 10.03                | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40590   | 50RB#0           | 8.9911                   | 10.30                | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 41190   | 50RB#0           | 8.9983                   | 9.877                | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 40115   | 75RB#0           | 13.544                   | 15.01                | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 40590   | 75RB#0           | 13.489                   | 14.91                | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 41165   | 75RB#0           | 13.516                   | 15.20                | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 40140   | 100RB#0          | 17.937                   | 19.72                | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 40590   | 100RB#0          | 17.951                   | 19.98                | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 41140   | 100RB#0          | 17.440                   | 20.14                | PASS    |



## Test Graphs

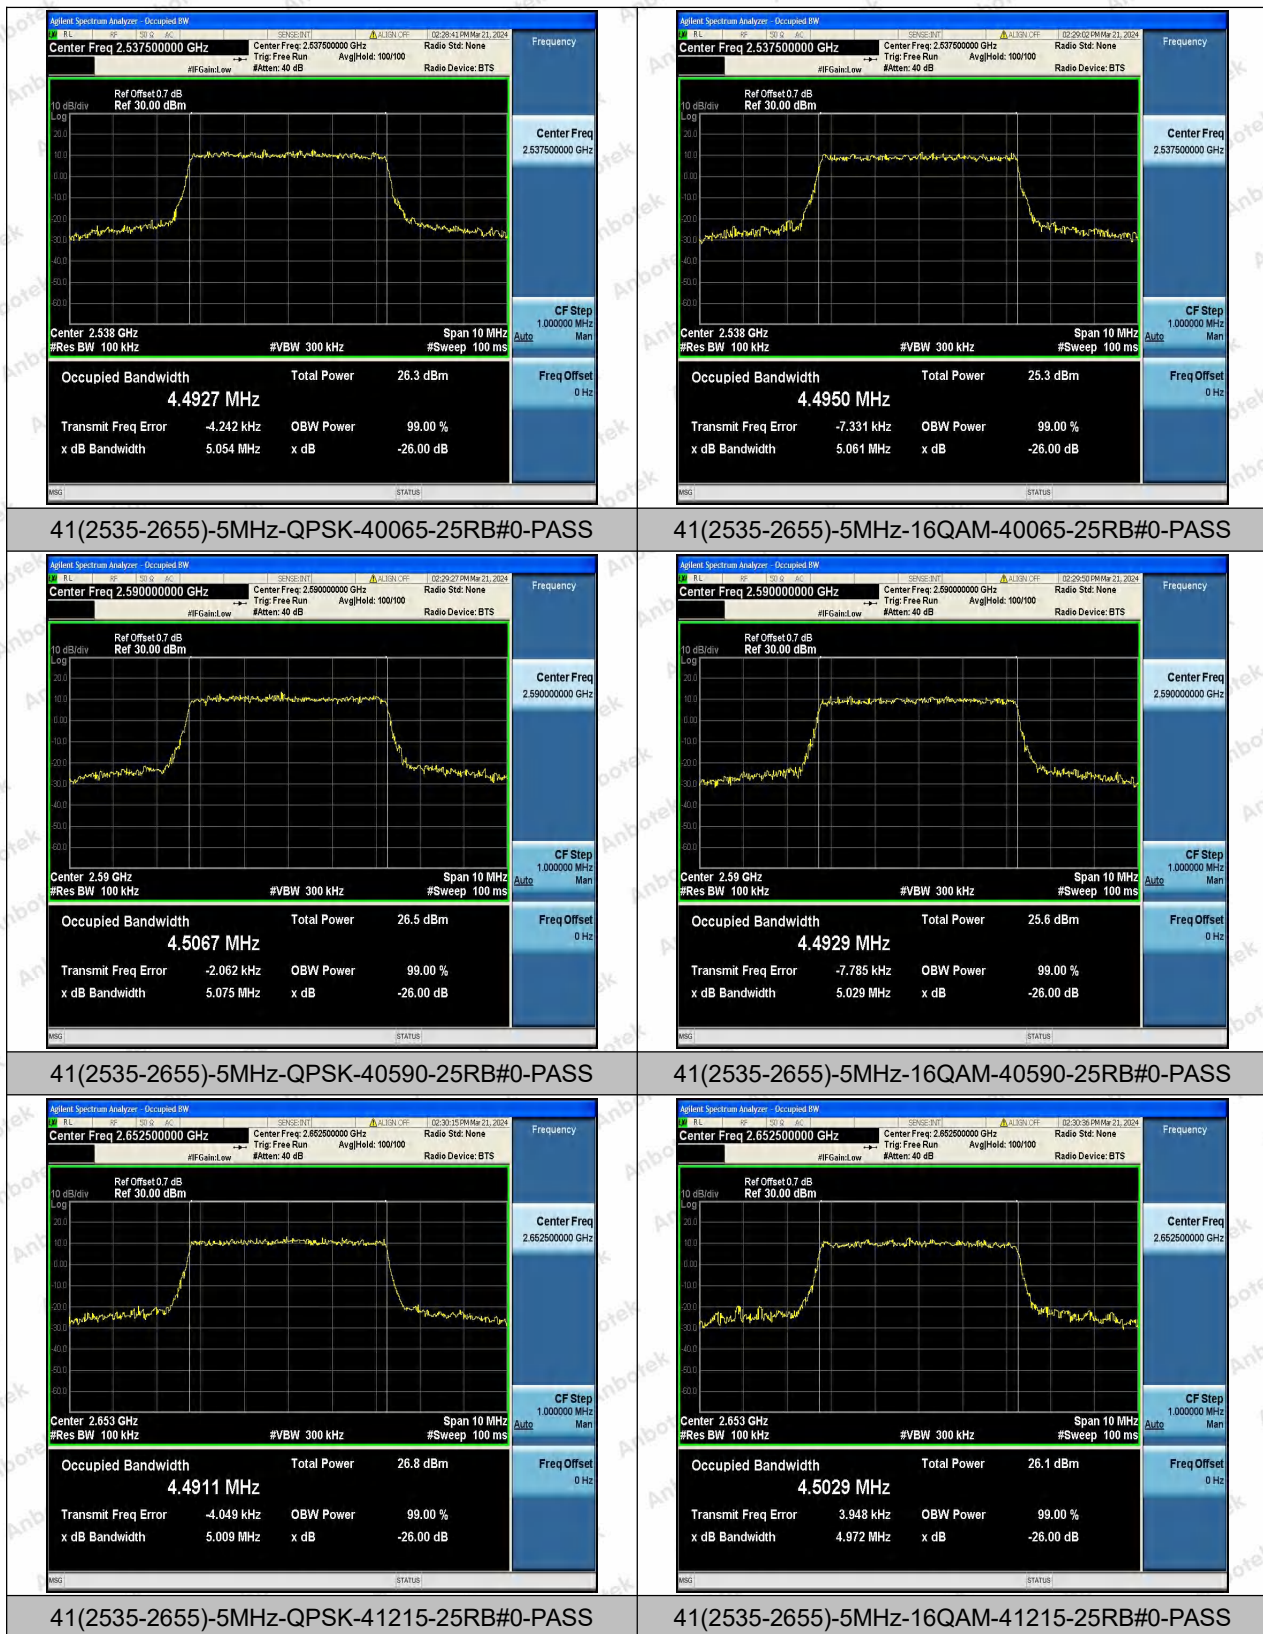

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline

400-003-0500

www.anbotek.com.cn



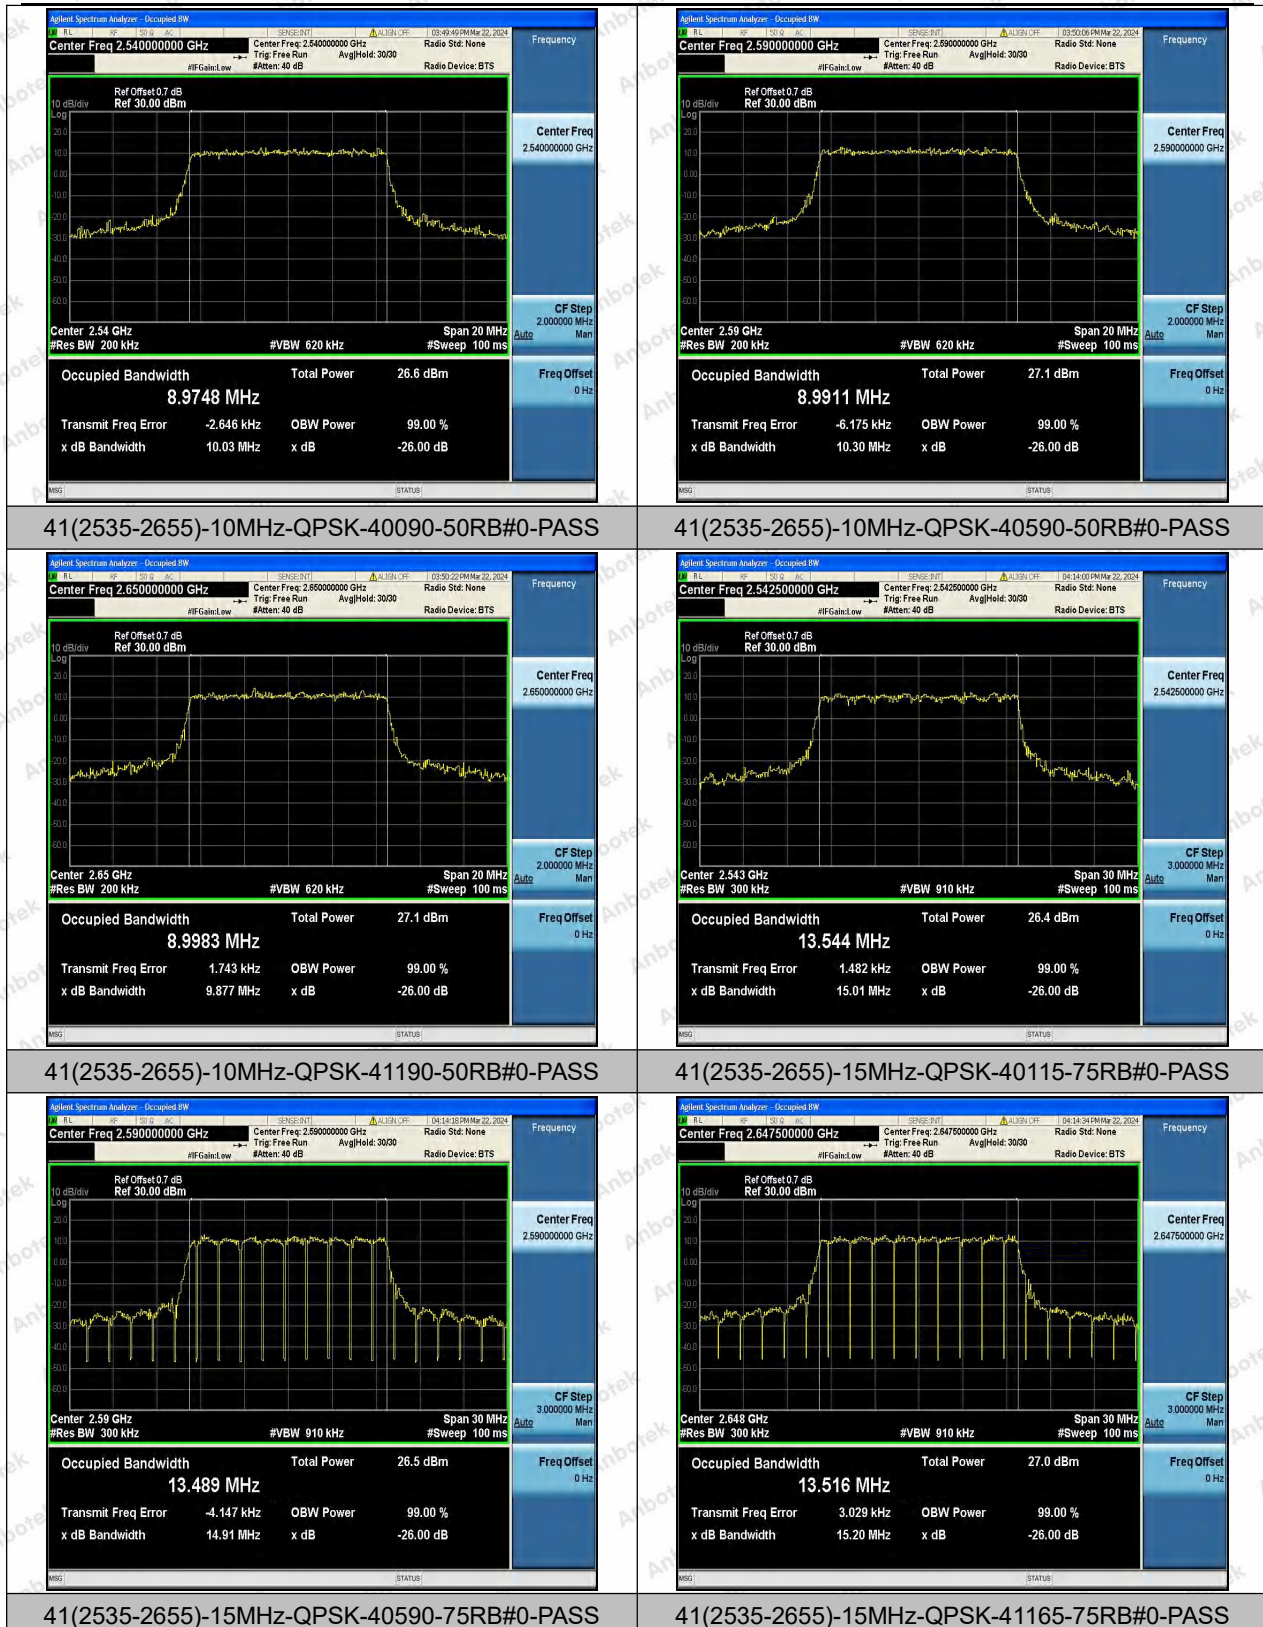



## Appendix D: Band Edge

### Test Result

| Band          | Bandwidth | Modulation | Channel | RB Configuration | Result(dBm) | Verdict |
|---------------|-----------|------------|---------|------------------|-------------|---------|
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 1RB#0            | -22.34      | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 1RB#0            | -22.11      | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 1RB#24           | -49.76      | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 1RB#24           | -48.99      | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 25RB#0           | -36.05      | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 25RB#0           | -38.75      | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 41215   | 1RB#0            | -40.31      | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 41215   | 1RB#0            | -41.12      | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 41215   | 1RB#24           | -15.54      | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 41215   | 1RB#24           | -17.75      | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 41215   | 25RB#0           | -32.60      | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 41215   | 25RB#0           | -49.07      | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40090   | 1RB#0            | -21.38      | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 40090   | 1RB#0            | -22.49      | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40090   | 1RB#49           | -59.80      | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 40090   | 1RB#49           | -59.78      | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 41190   | 1RB#0            | -55.55      | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 41190   | 1RB#0            | -55.51      | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 41190   | 1RB#49           | -15.51      | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 41190   | 1RB#49           | -16.72      | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40090   | 50RB#0           | -35.67      | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 41190   | 50RB#0           | -46.28      | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 40115   | 1RB#0            | -19.79      | PASS    |
| 41(2535-2655) | 15MHz     | 16QAM      | 40115   | 1RB#0            | -21.74      | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 40115   | 1RB#74           | -58.03      | PASS    |
| 41(2535-2655) | 15MHz     | 16QAM      | 40115   | 1RB#74           | -57.92      | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 41165   | 1RB#0            | -54.03      | PASS    |
| 41(2535-2655) | 15MHz     | 16QAM      | 41165   | 1RB#0            | -53.99      | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 41165   | 1RB#74           | -15.45      | PASS    |
| 41(2535-2655) | 15MHz     | 16QAM      | 41165   | 1RB#74           | -19.20      | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 40115   | 75RB#0           | -34.14      | PASS    |
| 41(2535-2655) | 15MHz     | QPSK       | 41165   | 75RB#0           | -42.64      | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 40140   | 1RB#0            | -21.75      | PASS    |
| 41(2535-2655) | 20MHz     | 16QAM      | 40140   | 1RB#0            | -23.82      | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 40140   | 1RB#99           | -56.88      | PASS    |
| 41(2535-2655) | 20MHz     | 16QAM      | 40140   | 1RB#99           | -56.60      | PASS    |
| 41(2535-2655) | 20MHz     | QPSK       | 41140   | 1RB#0            | -53.05      | PASS    |



|               |       |       |       |         |        |      |
|---------------|-------|-------|-------|---------|--------|------|
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 1RB#0   | -53.05 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 1RB#99  | -18.38 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 1RB#99  | -21.80 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 100RB#0 | -35.49 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 100RB#0 | -44.59 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



## Test Graphs

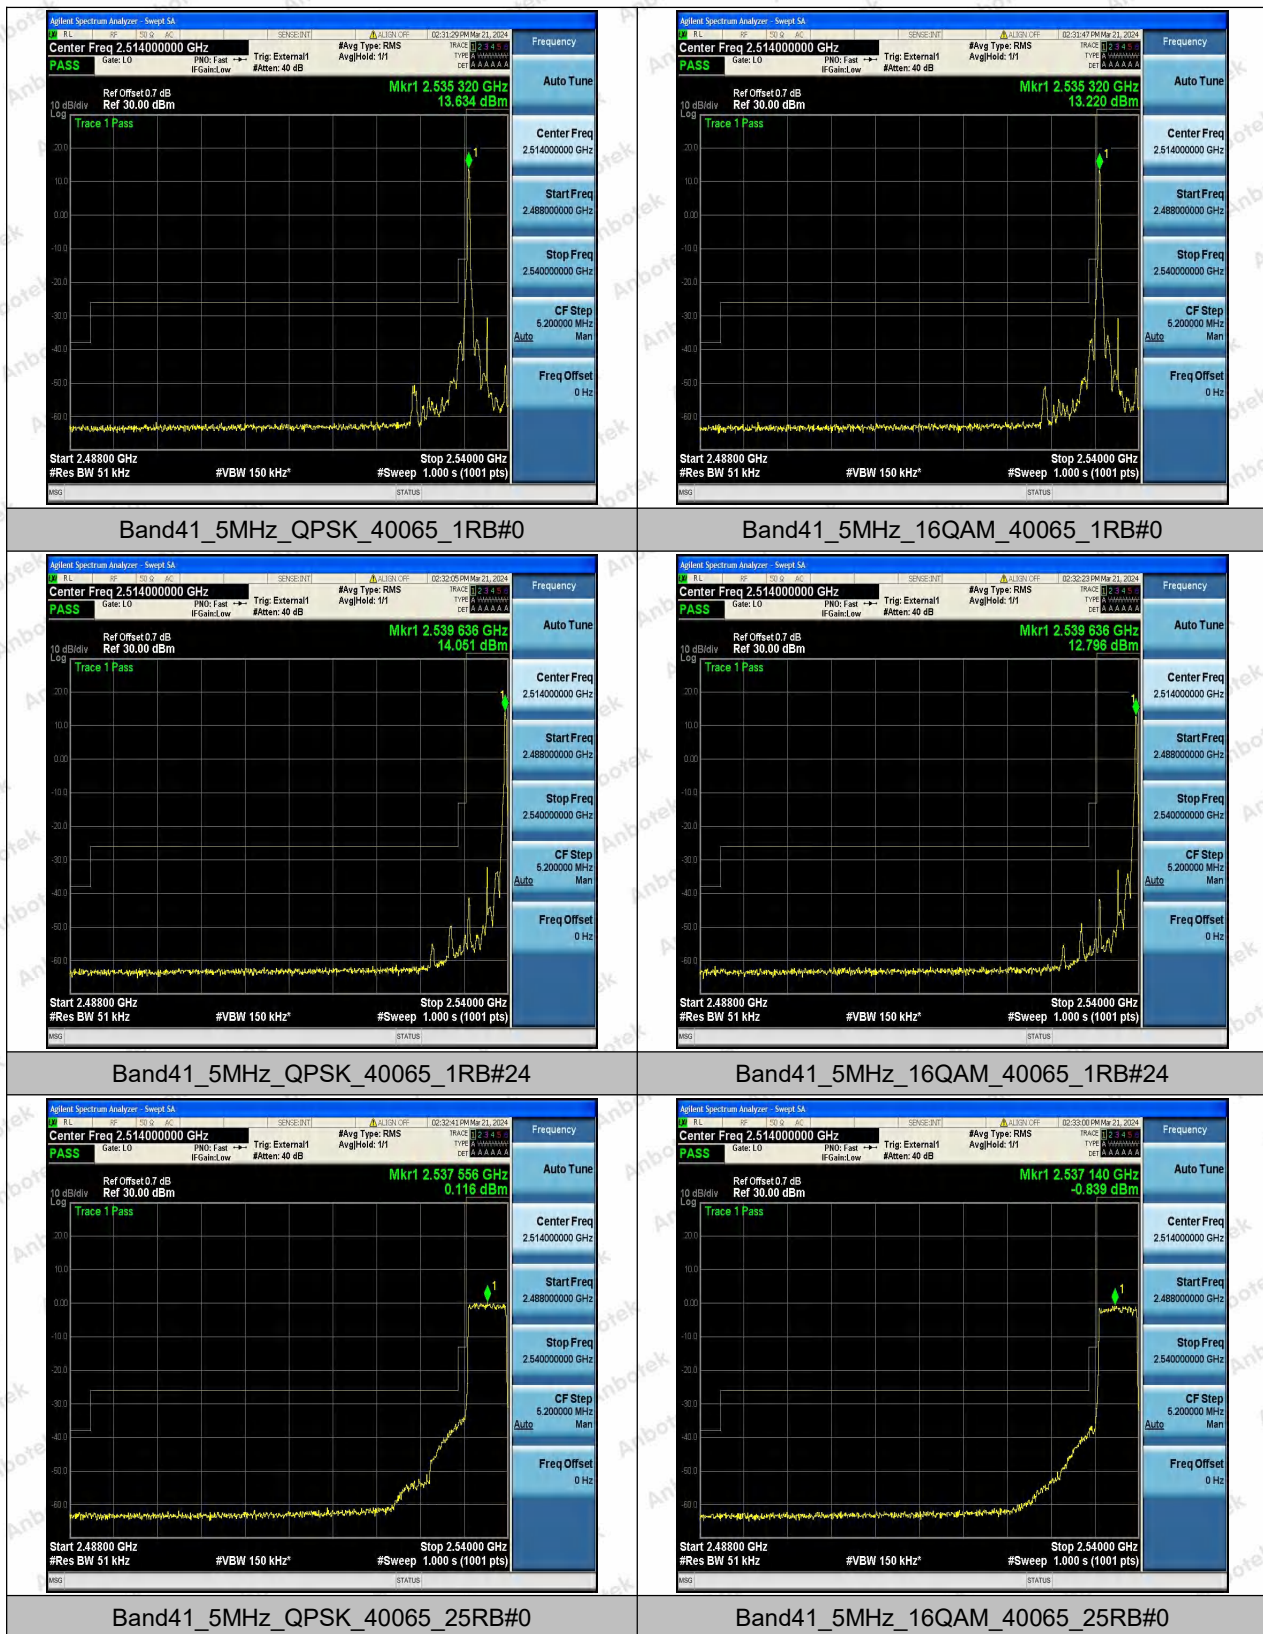


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



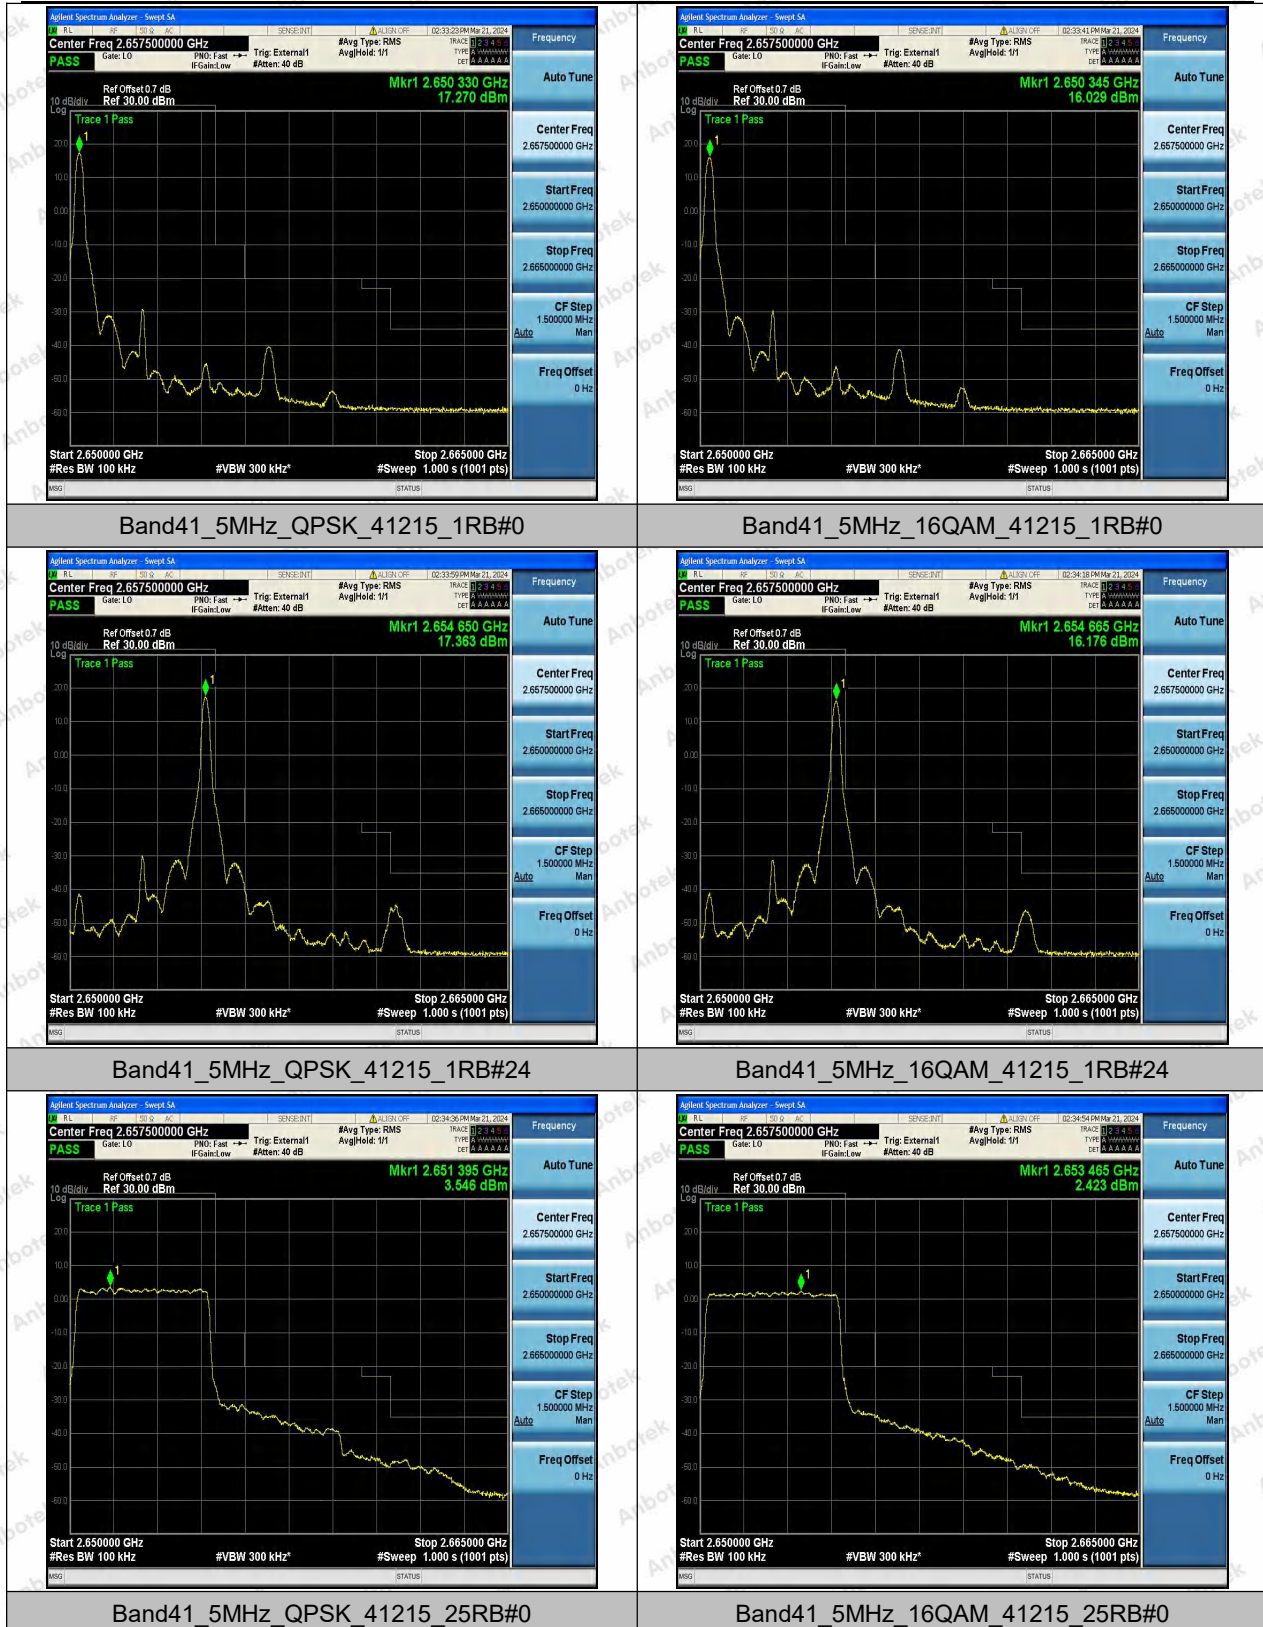


## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
 400-003-0500  
 www.anbotek.com.cn



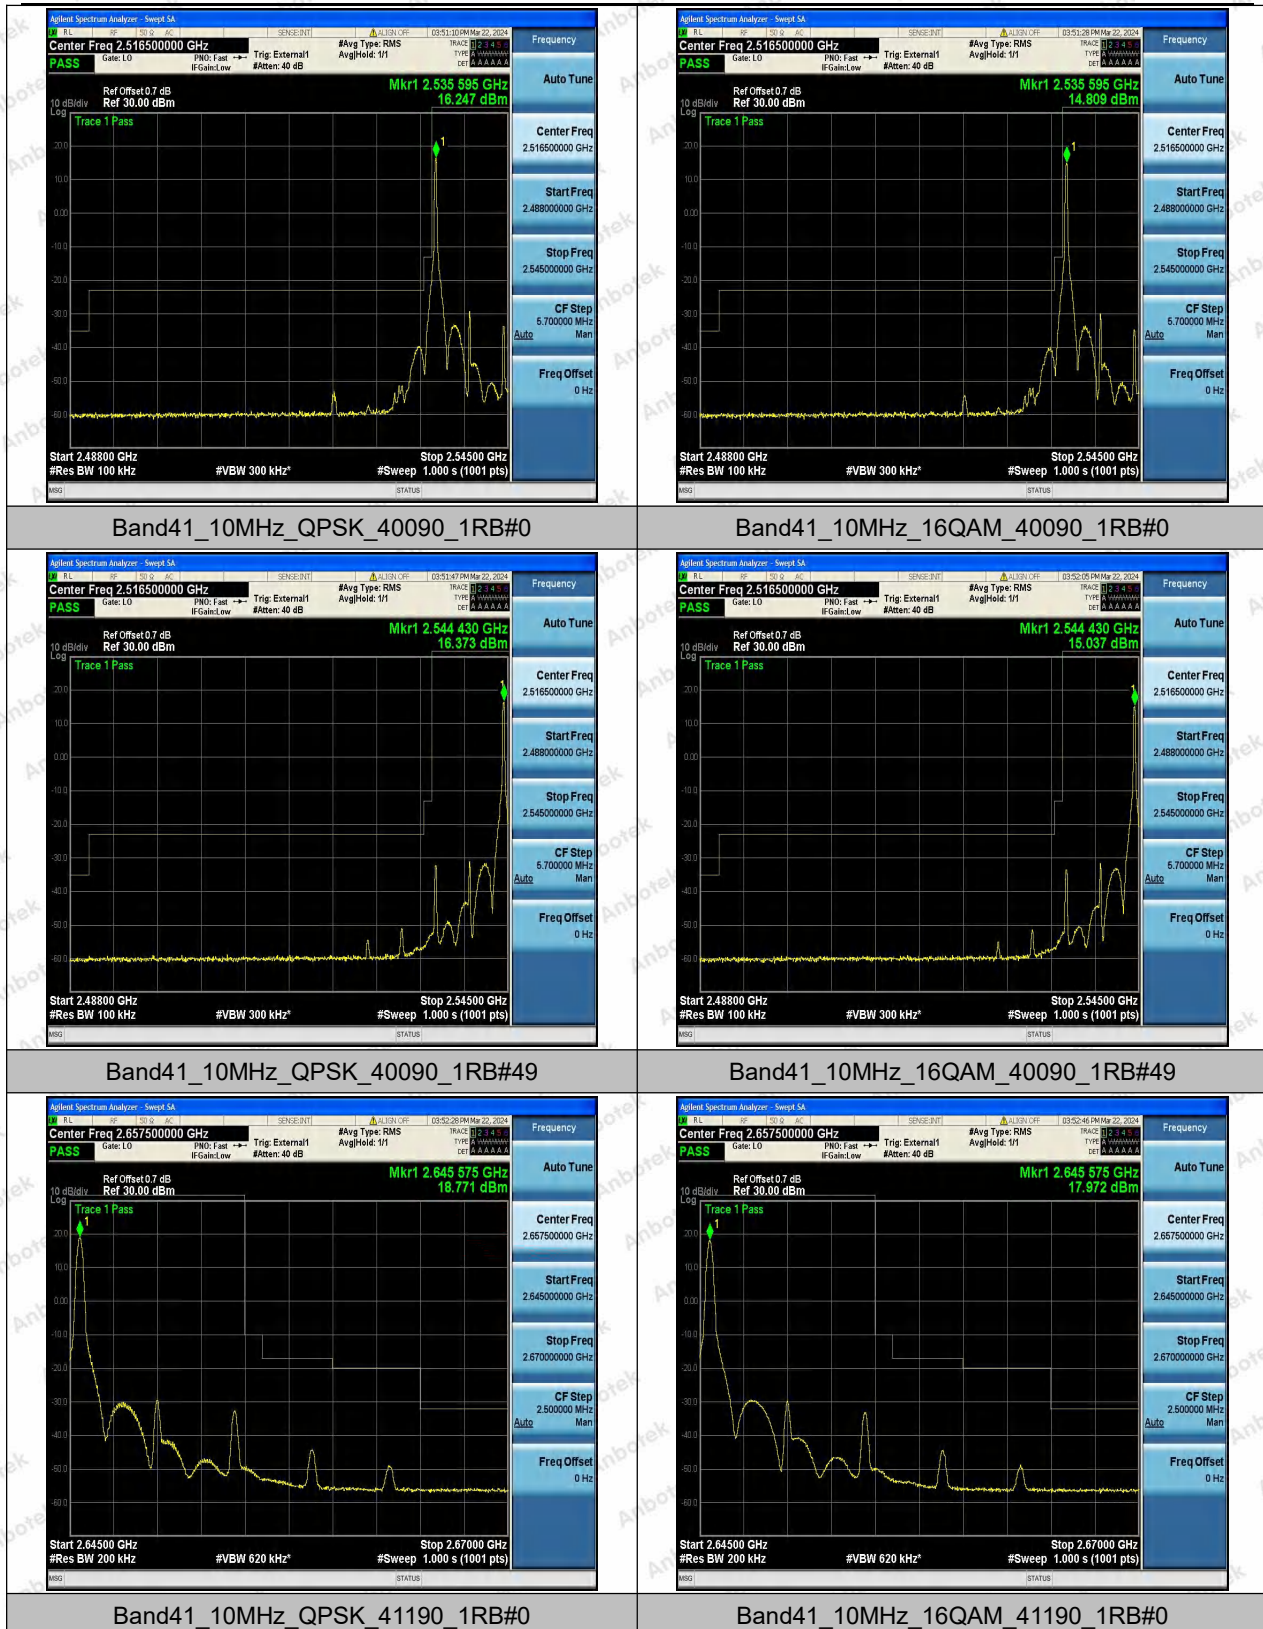

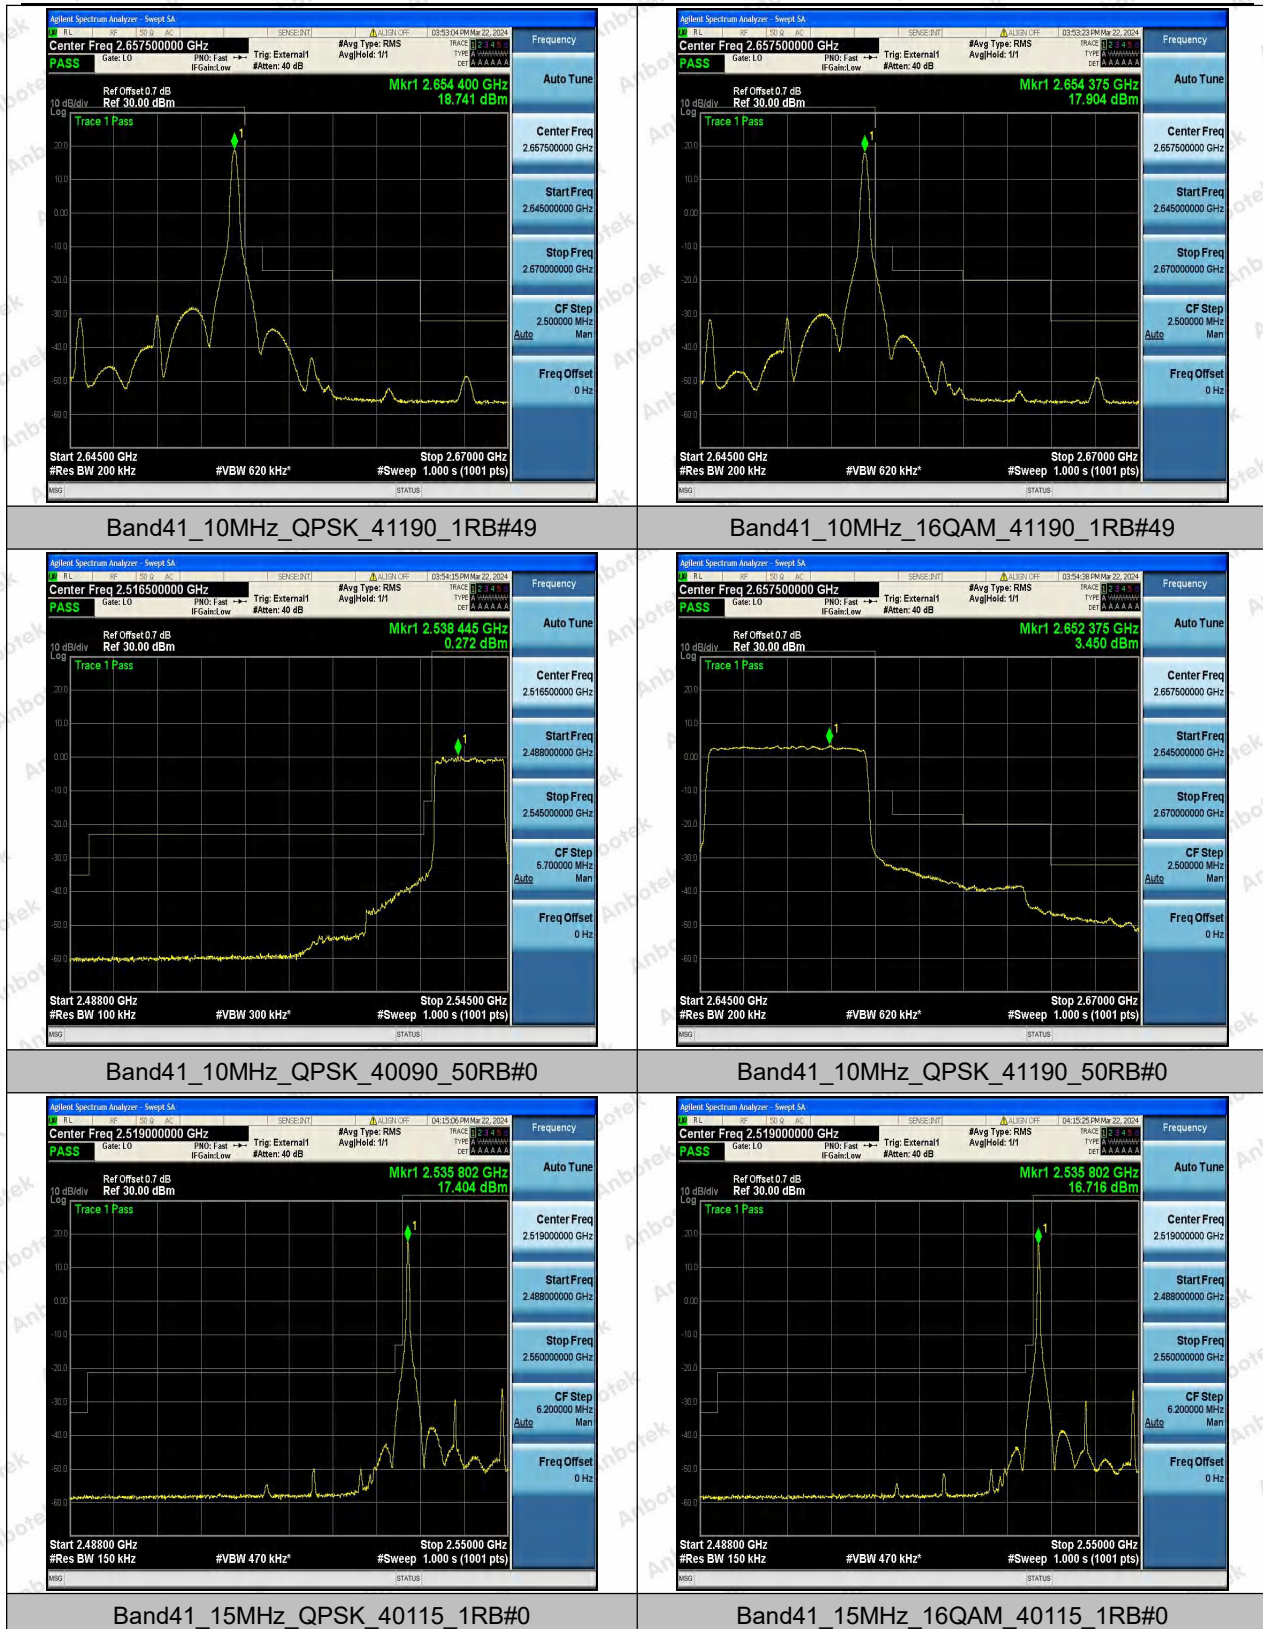

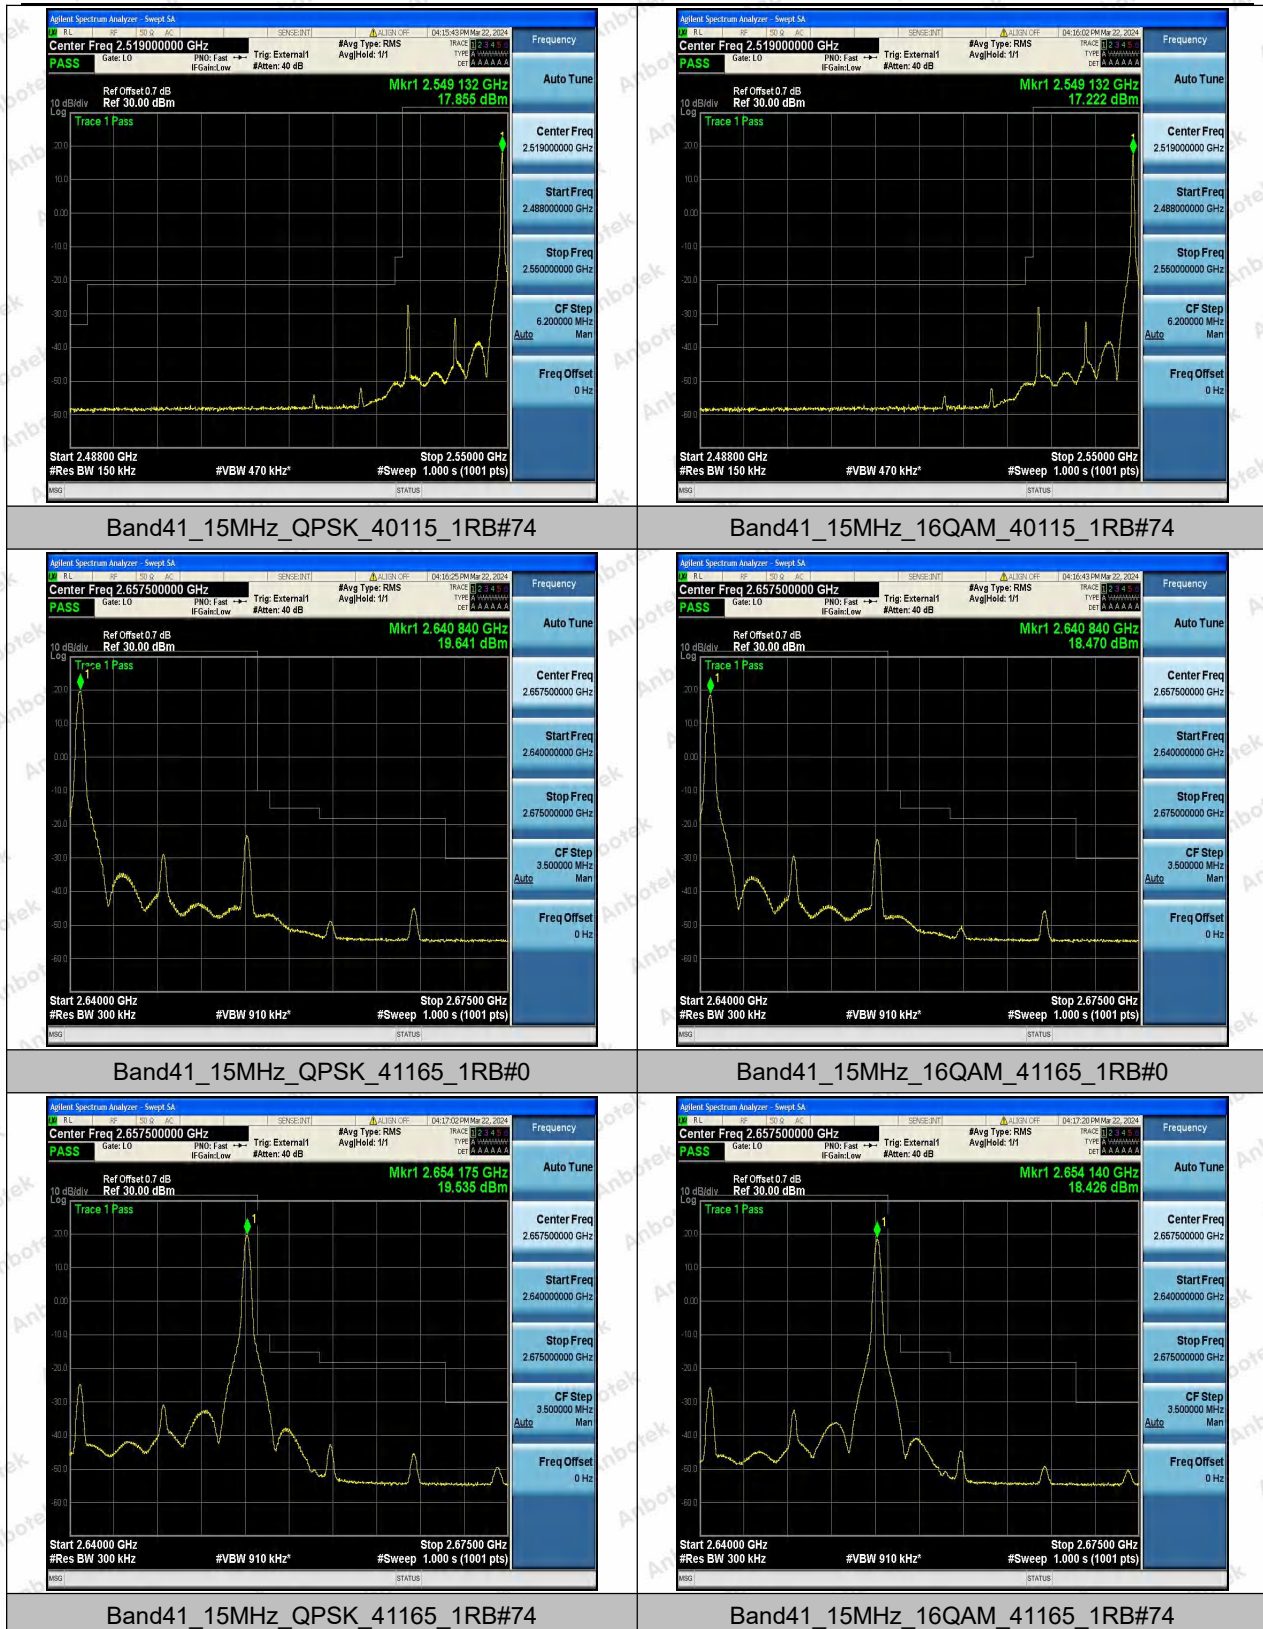


## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



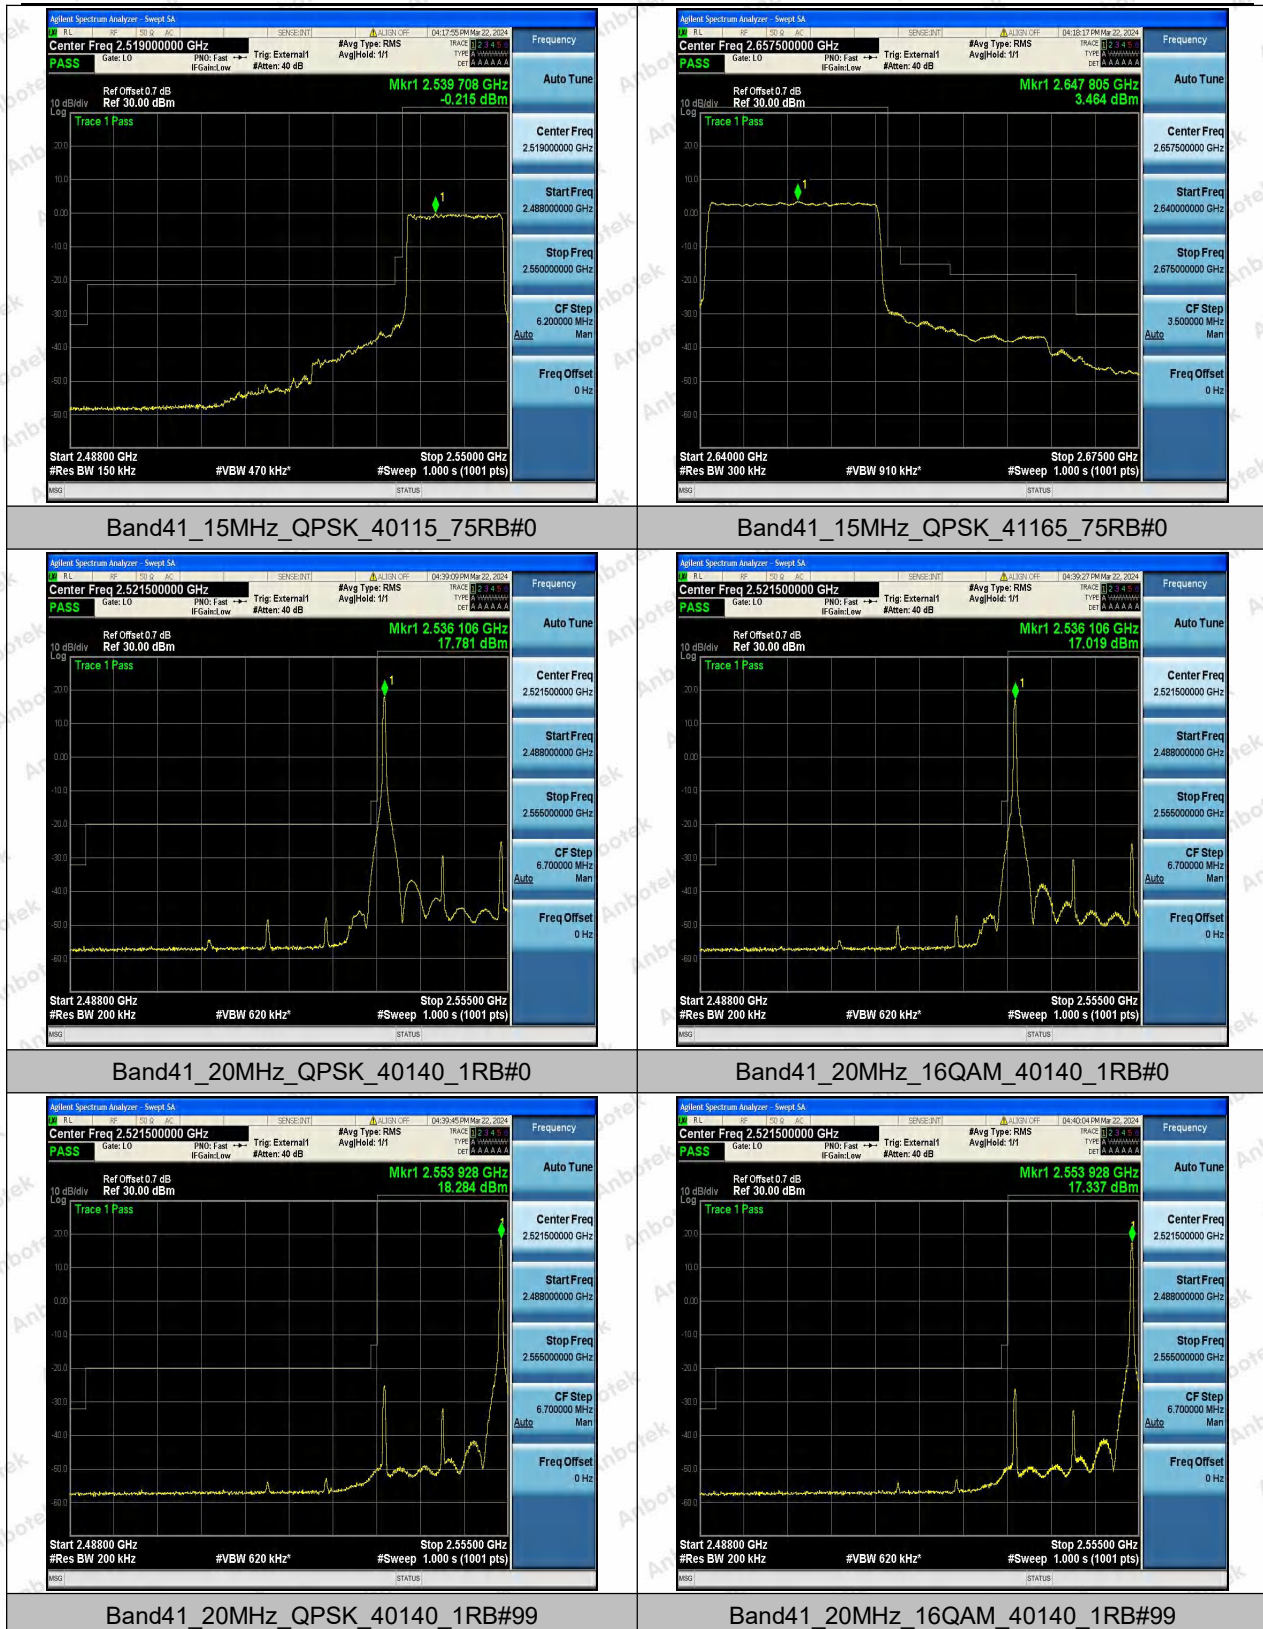

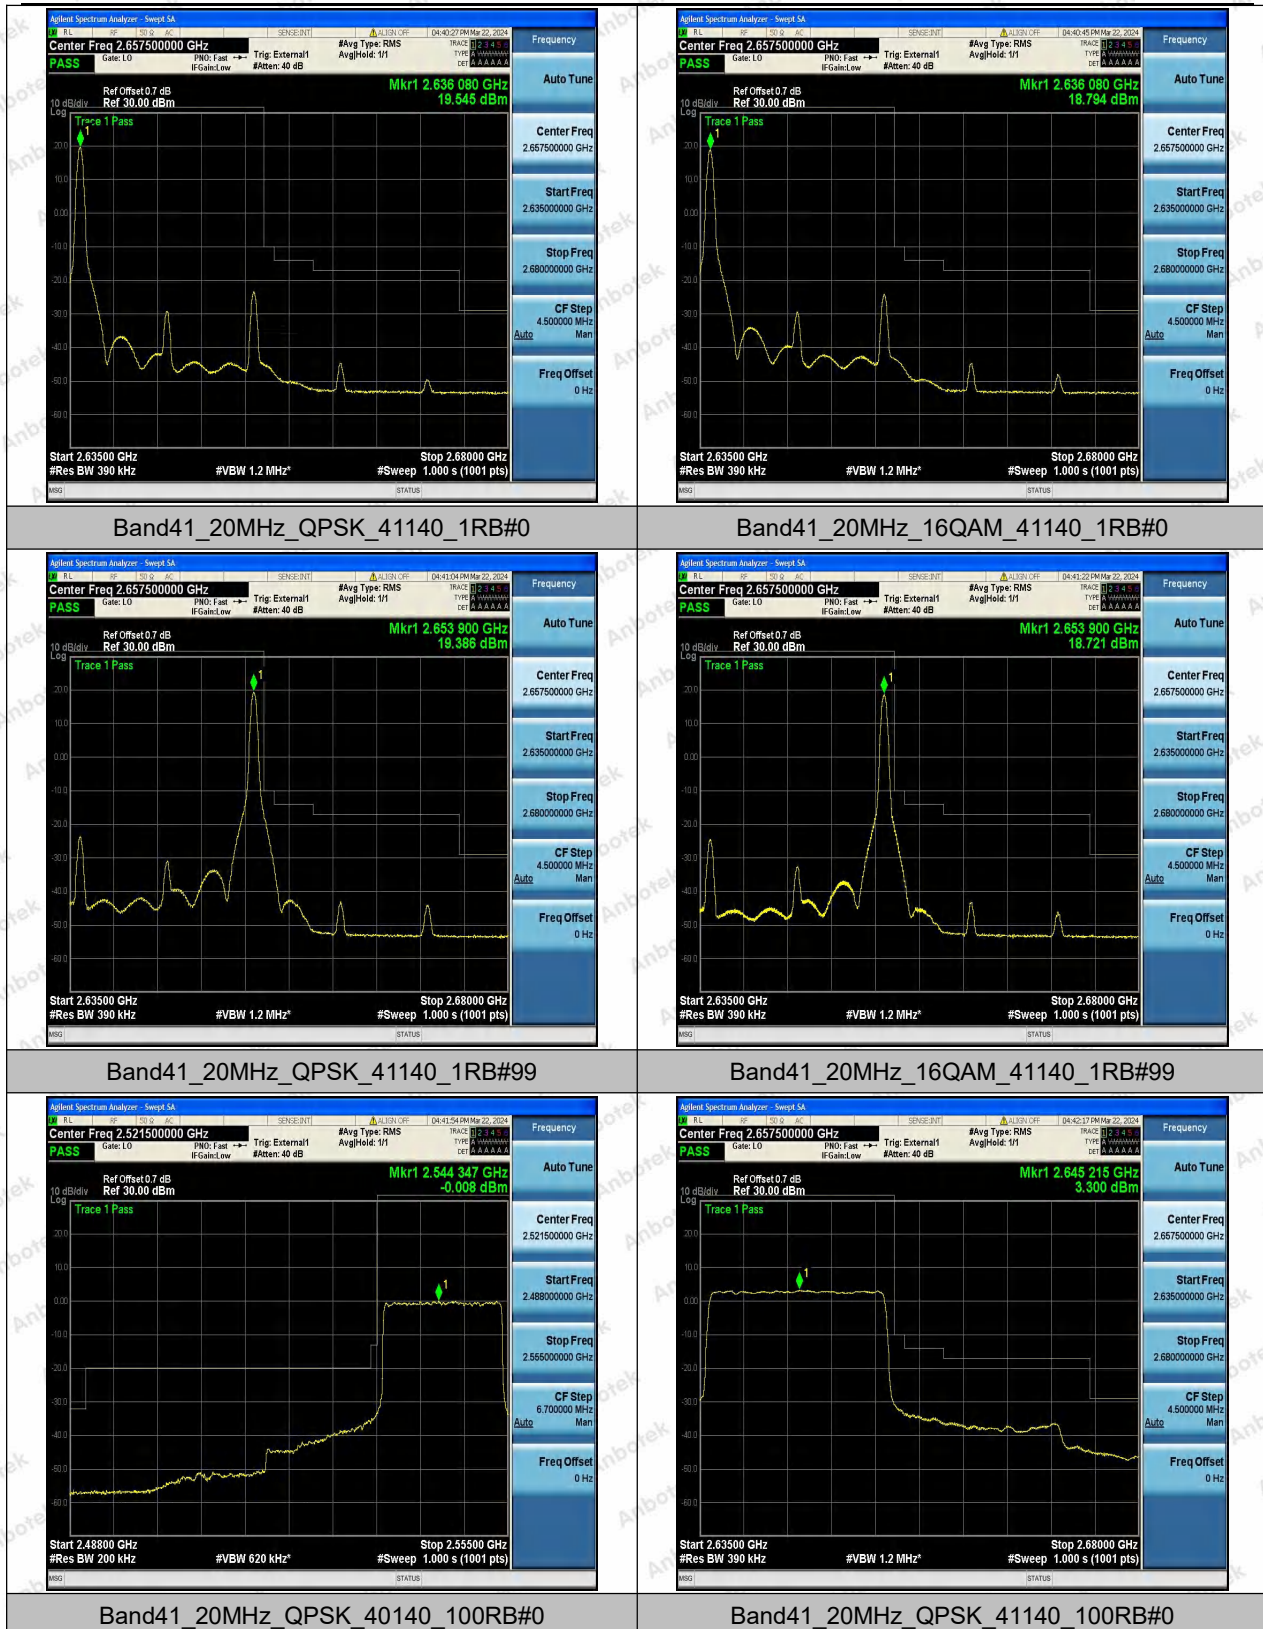

## Appendix E: Conducted Spurious Emission

### Test Result

| Band          | Bandwidth | Modulation | Channel | RB Configuration | Frequency Range | Result (dBm) | Verdict |
|---------------|-----------|------------|---------|------------------|-----------------|--------------|---------|
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 1RB#0            | 0.009~0.15      | -72.93       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 1RB#0            | 0.15~30         | -74.77       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 1RB#0            | 30~1000         | -70.64       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40065   | 1RB#0            | 20000~27000     | -46.25       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 1RB#0            | 0.009~0.15      | -73.45       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 1RB#0            | 0.15~30         | -71.05       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 1RB#0            | 30~1000         | -70.57       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40065   | 1RB#0            | 20000~27000     | -46.11       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 1RB#0            | 0.009~0.15      | -70.14       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 1RB#0            | 0.15~30         | -60.05       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 1RB#0            | 30~1000         | -70.55       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 40590   | 1RB#0            | 20000~27000     | -46.41       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 1RB#0            | 0.009~0.15      | -70.44       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 1RB#0            | 0.15~30         | -61.05       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 1RB#0            | 30~1000         | -70.46       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 40590   | 1RB#0            | 20000~27000     | -46.54       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 41215   | 1RB#0            | 0.009~0.15      | -70.61       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 41215   | 1RB#0            | 0.15~30         | -70.53       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 41215   | 1RB#0            | 30~1000         | -67.18       | PASS    |
| 41(2535-2655) | 5MHz      | QPSK       | 41215   | 1RB#0            | 20000~27000     | -46.23       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 41215   | 1RB#0            | 0.009~0.15      | -69.03       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 41215   | 1RB#0            | 0.15~30         | -73.08       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 41215   | 1RB#0            | 30~1000         | -66.25       | PASS    |
| 41(2535-2655) | 5MHz      | 16QAM      | 41215   | 1RB#0            | 20000~27000     | -46.33       | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40090   | 1RB#0            | 0.009~0.15      | -73.20       | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40090   | 1RB#0            | 0.15~30         | -69.89       | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40090   | 1RB#0            | 30~1000         | -70.34       | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40090   | 1RB#0            | 20000~27000     | -45.91       | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 40090   | 1RB#0            | 0.009~0.15      | -72.69       | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 40090   | 1RB#0            | 0.15~30         | -72.24       | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 40090   | 1RB#0            | 30~1000         | -70.47       | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 40090   | 1RB#0            | 20000~27000     | -46.20       | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40590   | 1RB#0            | 0.009~0.15      | -70.29       | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40590   | 1RB#0            | 0.15~30         | -59.71       | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40590   | 1RB#0            | 30~1000         | -70.05       | PASS    |
| 41(2535-2655) | 10MHz     | QPSK       | 40590   | 1RB#0            | 20000~27000     | -45.71       | PASS    |
| 41(2535-2655) | 10MHz     | 16QAM      | 40590   | 1RB#0            | 0.009~0.15      | -71.45       | PASS    |

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn




|               |       |       |       |       |             |        |      |
|---------------|-------|-------|-------|-------|-------------|--------|------|
| 41(2535-2655) | 10MHz | 16QAM | 40590 | 1RB#0 | 0.15~30     | -60.66 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40590 | 1RB#0 | 30~1000     | -70.41 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 40590 | 1RB#0 | 20000~27000 | -45.71 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 41190 | 1RB#0 | 0.009~0.15  | -70.85 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 41190 | 1RB#0 | 0.15~30     | -70.83 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 41190 | 1RB#0 | 30~1000     | -65.08 | PASS |
| 41(2535-2655) | 10MHz | QPSK  | 41190 | 1RB#0 | 20000~27000 | -45.82 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 41190 | 1RB#0 | 0.009~0.15  | -72.25 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 41190 | 1RB#0 | 0.15~30     | -68.90 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 41190 | 1RB#0 | 30~1000     | -66.34 | PASS |
| 41(2535-2655) | 10MHz | 16QAM | 41190 | 1RB#0 | 20000~27000 | -45.65 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40115 | 1RB#0 | 0.009~0.15  | -69.85 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40115 | 1RB#0 | 0.15~30     | -71.58 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40115 | 1RB#0 | 30~1000     | -70.04 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40115 | 1RB#0 | 20000~27000 | -45.88 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40115 | 1RB#0 | 0.009~0.15  | -71.66 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40115 | 1RB#0 | 0.15~30     | -69.67 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40115 | 1RB#0 | 30~1000     | -70.27 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40115 | 1RB#0 | 20000~27000 | -46.11 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40590 | 1RB#0 | 0.009~0.15  | -70.60 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40590 | 1RB#0 | 0.15~30     | -57.65 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40590 | 1RB#0 | 30~1000     | -70.56 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 40590 | 1RB#0 | 20000~27000 | -45.99 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40590 | 1RB#0 | 0.009~0.15  | -71.68 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40590 | 1RB#0 | 0.15~30     | -60.53 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40590 | 1RB#0 | 30~1000     | -70.20 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 40590 | 1RB#0 | 20000~27000 | -45.91 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 41165 | 1RB#0 | 0.009~0.15  | -70.76 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 41165 | 1RB#0 | 0.15~30     | -70.99 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 41165 | 1RB#0 | 30~1000     | -65.62 | PASS |
| 41(2535-2655) | 15MHz | QPSK  | 41165 | 1RB#0 | 20000~27000 | -46.13 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 41165 | 1RB#0 | 0.009~0.15  | -70.63 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 41165 | 1RB#0 | 0.15~30     | -71.90 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 41165 | 1RB#0 | 30~1000     | -66.96 | PASS |
| 41(2535-2655) | 15MHz | 16QAM | 41165 | 1RB#0 | 20000~27000 | -45.84 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 1RB#0 | 0.009~0.15  | -74.27 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 1RB#0 | 0.15~30     | -70.12 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 1RB#0 | 30~1000     | -70.05 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40140 | 1RB#0 | 20000~27000 | -46.09 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40140 | 1RB#0 | 0.009~0.15  | -73.66 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40140 | 1RB#0 | 0.15~30     | -72.91 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40140 | 1RB#0 | 30~1000     | -70.19 | PASS |



|               |       |       |       |       |             |        |      |
|---------------|-------|-------|-------|-------|-------------|--------|------|
| 41(2535-2655) | 20MHz | 16QAM | 40140 | 1RB#0 | 20000~27000 | -45.91 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40590 | 1RB#0 | 0.009~0.15  | -69.79 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40590 | 1RB#0 | 0.15~30     | -59.27 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40590 | 1RB#0 | 30~1000     | -70.31 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 40590 | 1RB#0 | 20000~27000 | -45.68 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40590 | 1RB#0 | 0.009~0.15  | -69.27 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40590 | 1RB#0 | 0.15~30     | -60.65 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40590 | 1RB#0 | 30~1000     | -70.04 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 40590 | 1RB#0 | 20000~27000 | -46.15 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 1RB#0 | 0.009~0.15  | -70.68 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 1RB#0 | 0.15~30     | -71.47 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 1RB#0 | 30~1000     | -65.20 | PASS |
| 41(2535-2655) | 20MHz | QPSK  | 41140 | 1RB#0 | 20000~27000 | -45.89 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 1RB#0 | 0.009~0.15  | -70.56 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 1RB#0 | 0.15~30     | -71.30 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 1RB#0 | 30~1000     | -66.96 | PASS |
| 41(2535-2655) | 20MHz | 16QAM | 41140 | 1RB#0 | 20000~27000 | -46.01 | PASS |



## Test Graphs

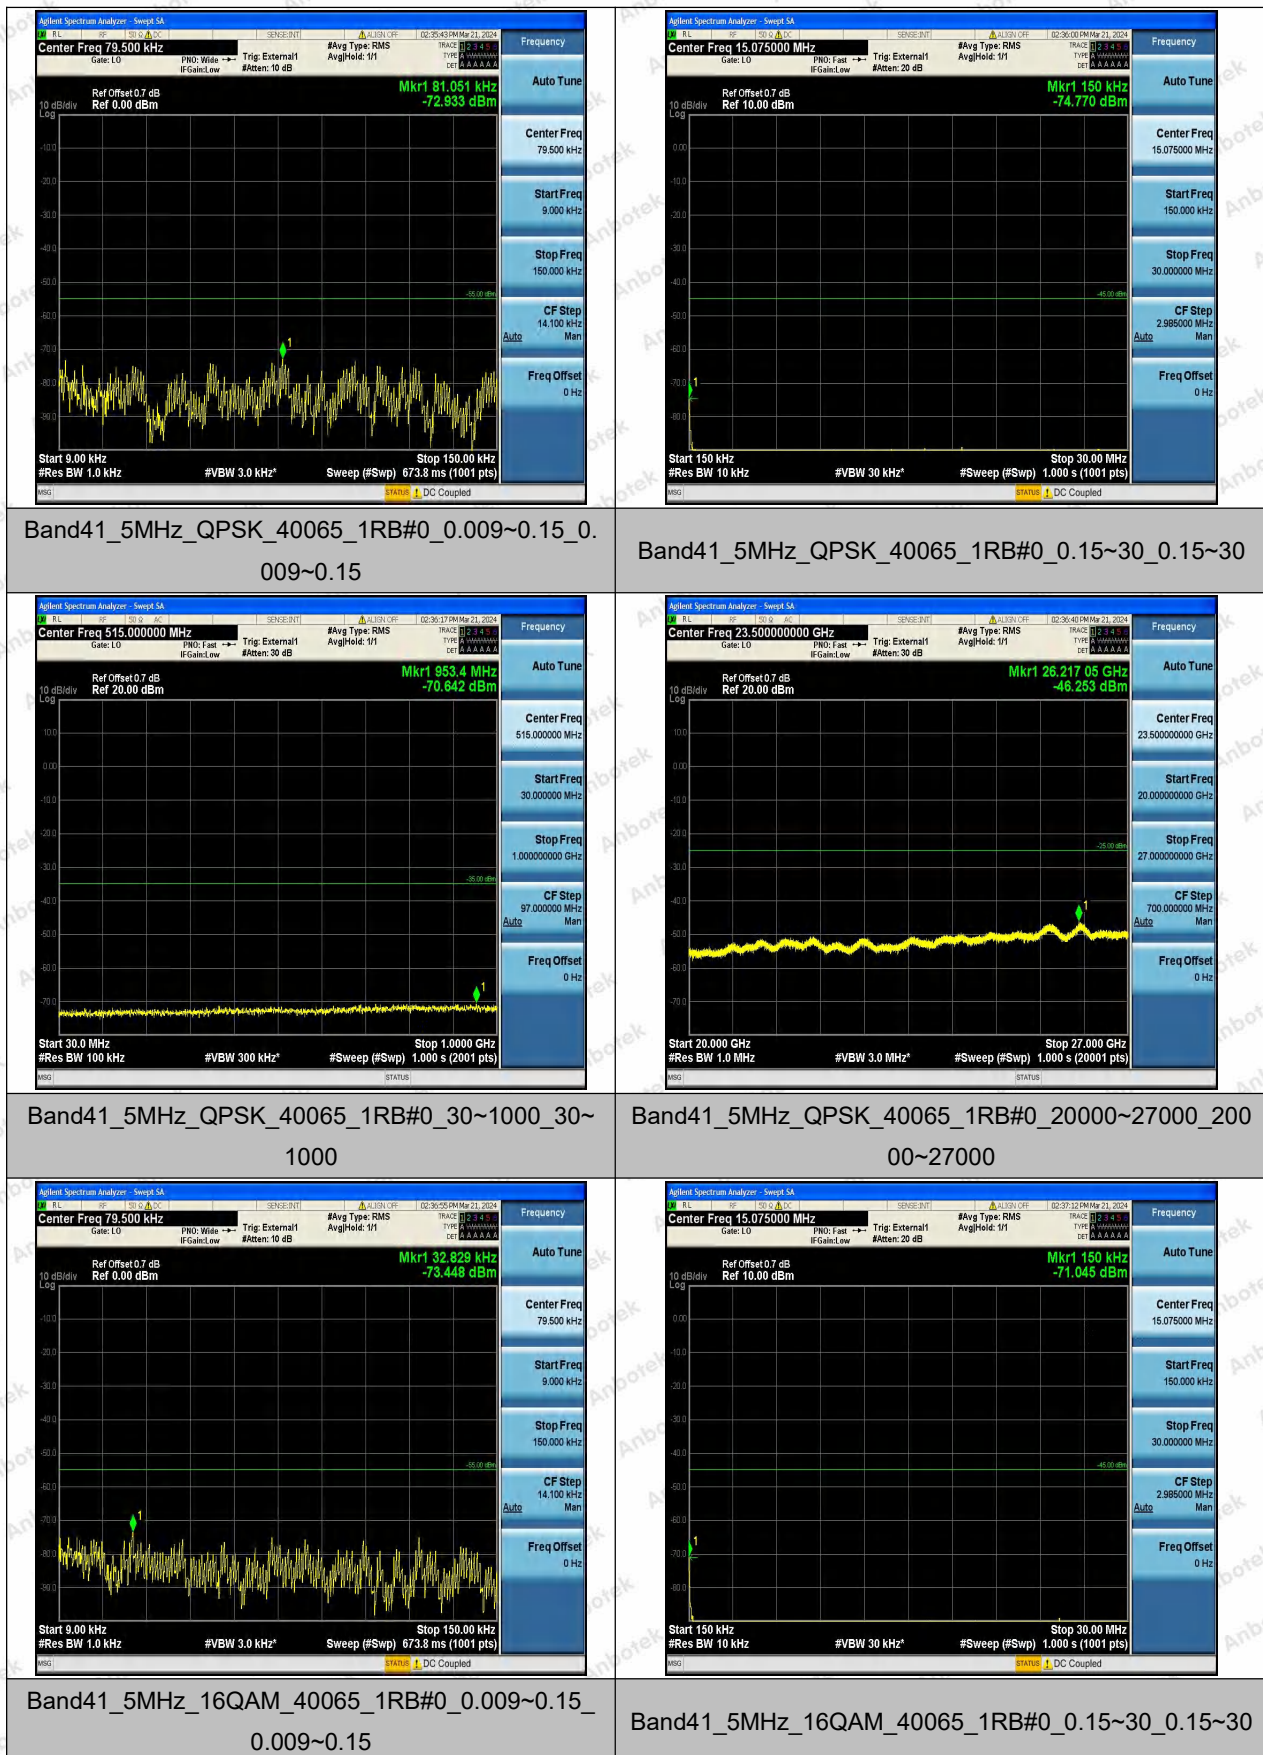

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn

