





Band41_5MHz_16QAM_40065_1RB#0_30~1000_30
~1000




Band41_5MHz_16QAM_40065_1RB#0_20000~27000_20
000~27000

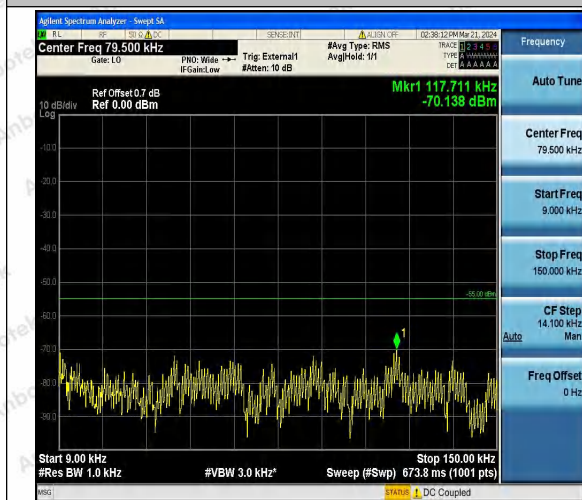


Band41_5MHz_QPSK_40590_1RB#0_0.009~0.15_0
009~0.15

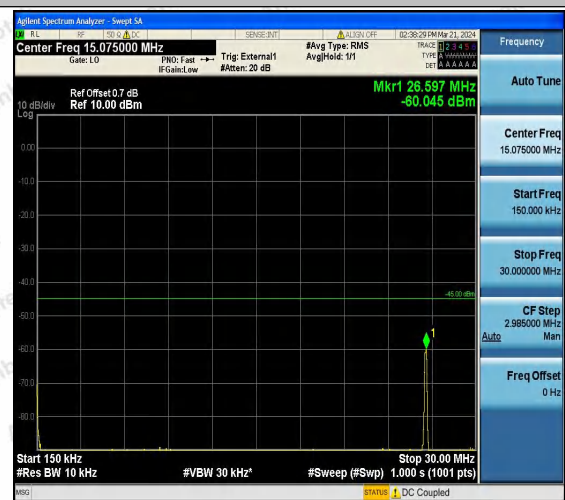

Band41_5MHz_QPSK_40590_1RB#0_0.15~30_0.15~30

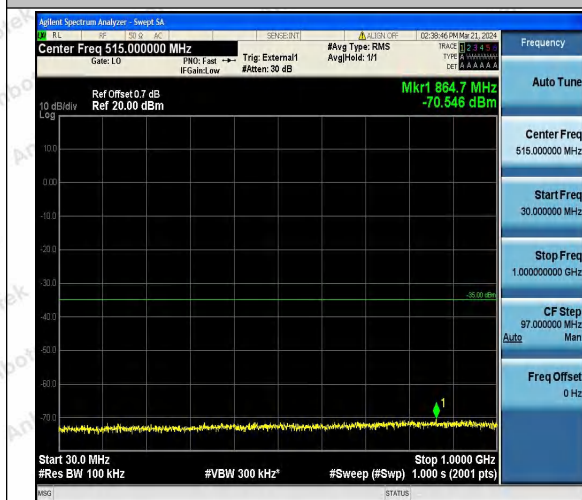


Band41_5MHz_QPSK_40590_1RB#0_30~1000_30~
1000

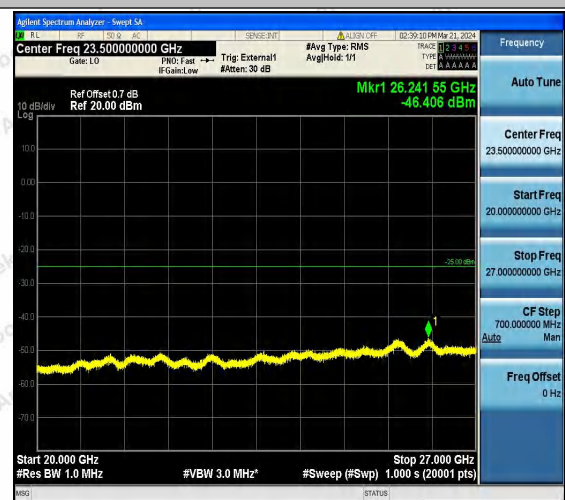


Band41_5MHz_QPSK_40590_1RB#0_20000~27000_200
00~27000



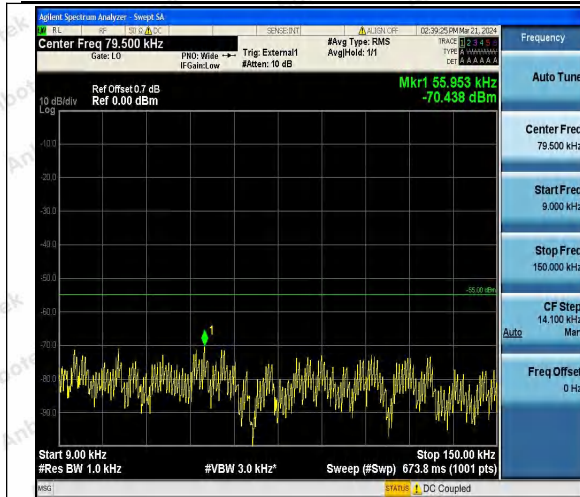

Band41_5MHz_16QAM_40590_1RB#0_0.009~0.15_0.009~0.15

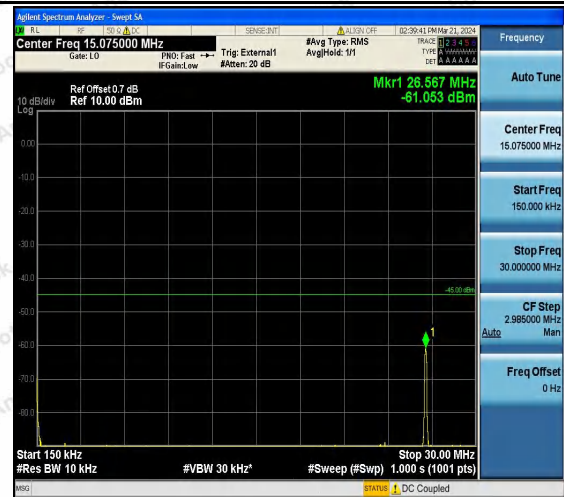


Band41_5MHz_16QAM_40590_1RB#0_0.15~30_0.15~30




Band41_5MHz_16QAM_40590_1RB#0_30~1000_30~1000



Band41_5MHz_16QAM_40590_1RB#0_20000~27000_20000~27000

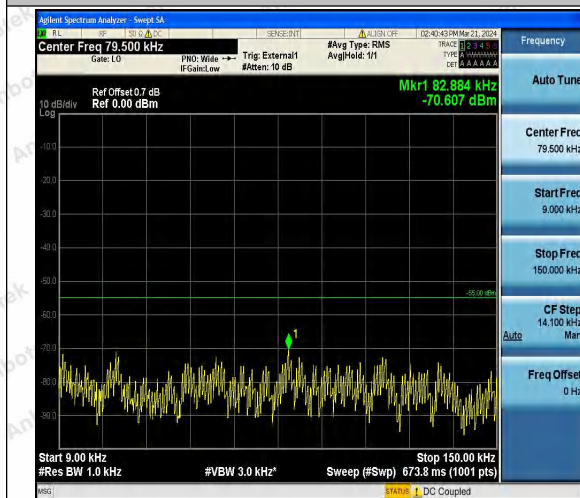


Band41_5MHz_QPSK_41215_1RB#0_0.009~0.15_0.009~0.15

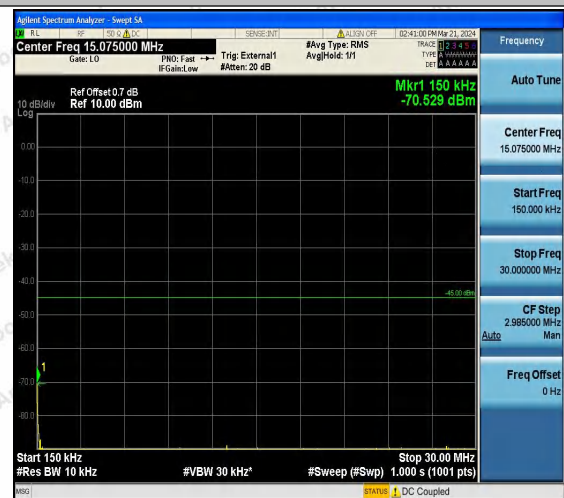

Band41_5MHz_QPSK_41215_1RB#0_0.15~30_0.15~30




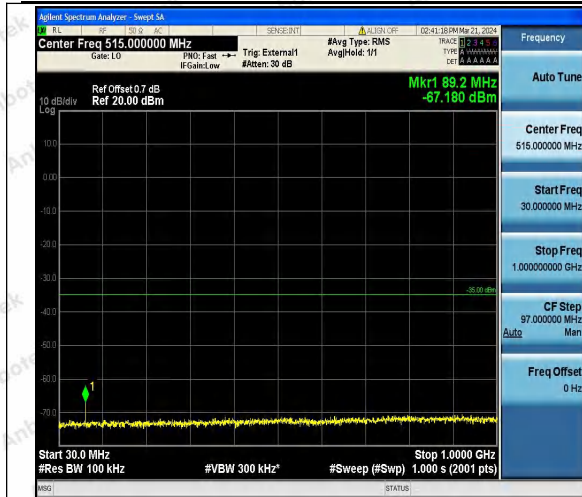


Band41_5MHz_QPSK_41215_1RB#0_30~1000_30~1000



Band41_5MHz_QPSK_41215_1RB#0_20000~27000_20000~27000

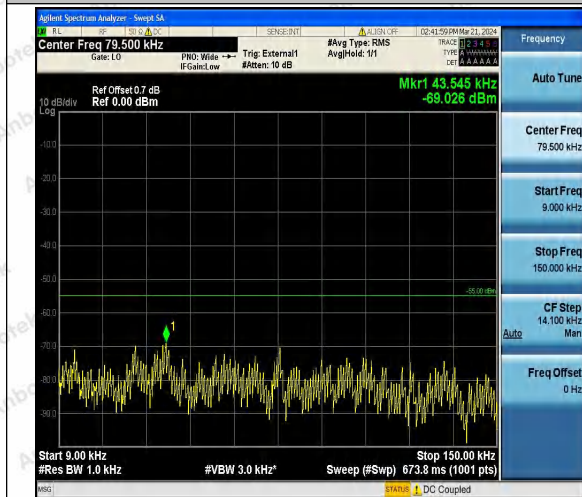


Band41_5MHz_16QAM_41215_1RB#0_0.009~0.15_0.009~0.15

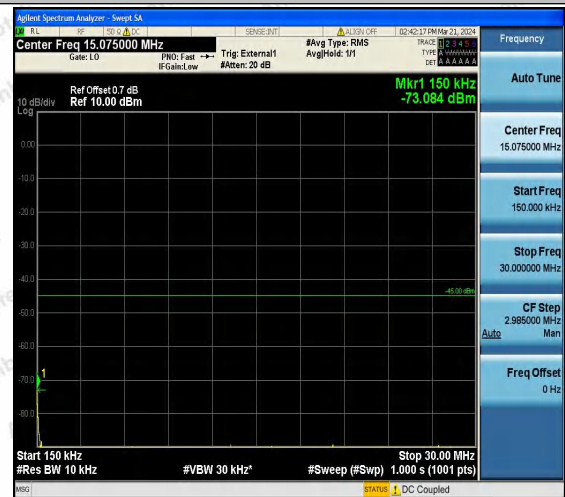

Band41_5MHz_16QAM_41215_1RB#0_0.15~30_0.15~30



Band41_5MHz_16QAM_41215_1RB#0_30~1000_30~1000

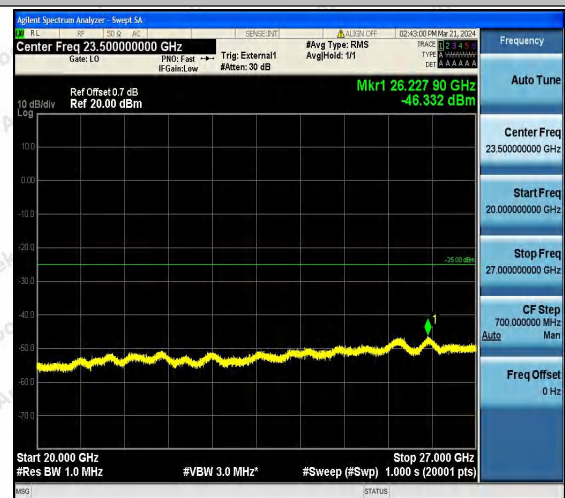


Band41_5MHz_16QAM_41215_1RB#0_20000~27000_20000~27000





Band41_10MHz_QPSK_40090_1RB#0_0.009~0.15_0.009~0.15

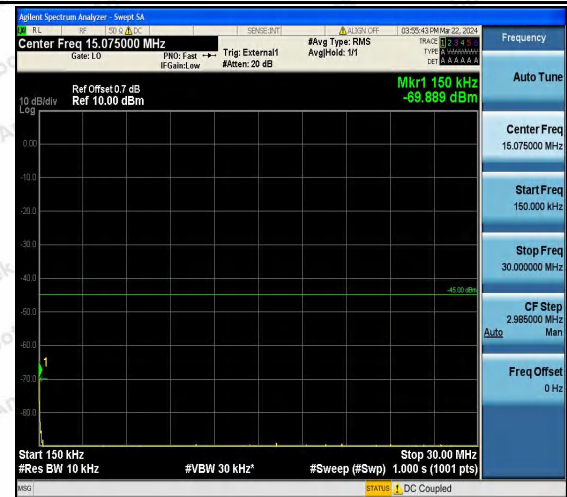

Band41_10MHz_QPSK_40090_1RB#0_0.15~30_0.15~30




Band41_10MHz_QPSK_40090_1RB#0_30~1000_30~1000



Band41_10MHz_QPSK_40090_1RB#0_20000~27000_20000~27000




Band41_10MHz_16QAM_40090_1RB#0_0.009~0.15_0.009~0.15

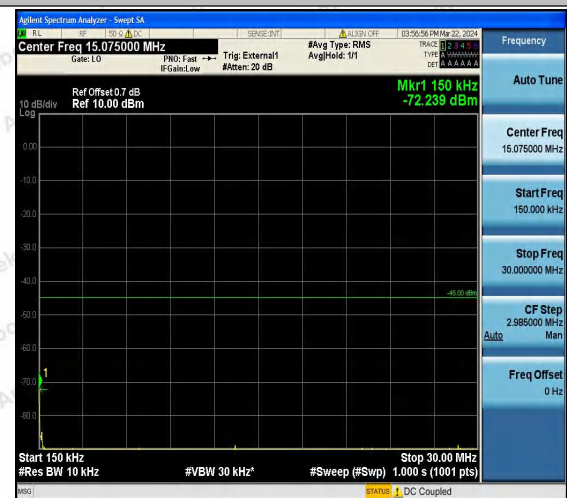


Band41_10MHz_16QAM_40090_1RB#0_0.15~30_0.15~30




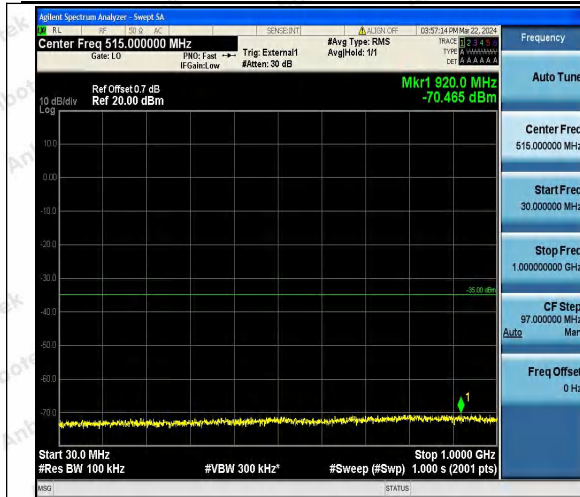


Band41_10MHz_16QAM_40090_1RB#0_30~1000_3
0~1000

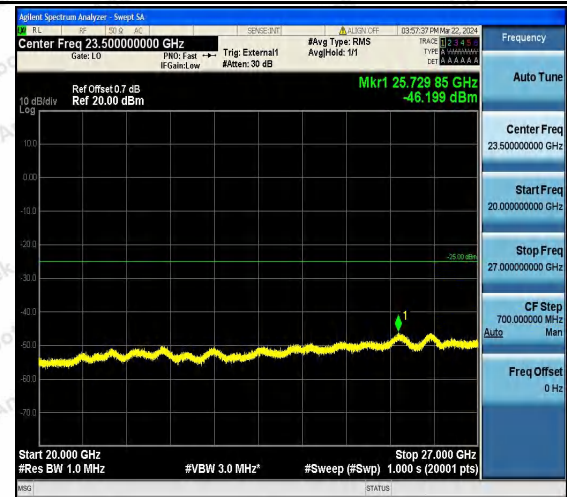

Band41_10MHz_16QAM_40090_1RB#0_20000~27000_2
0000~27000

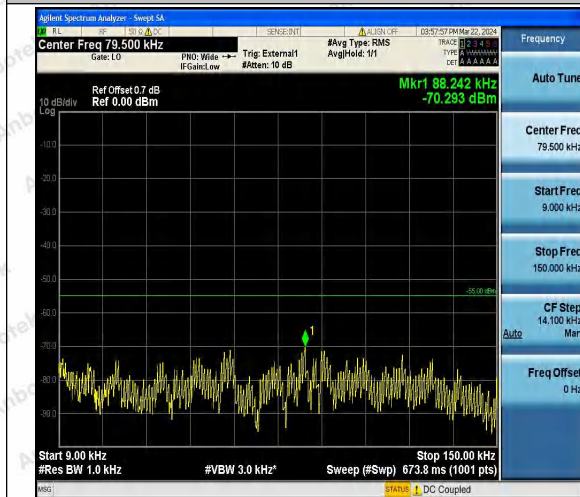


Band41_10MHz_QPSK_40590_1RB#0_0.009~0.15
0.009~0.15

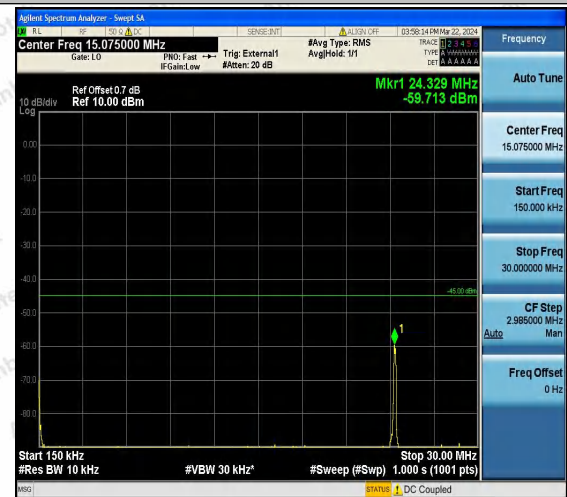

Band41_10MHz_QPSK_40590_1RB#0_0.15~30_0.15~30




Band41_10MHz_QPSK_40590_1RB#0_30~1000_30
~1000

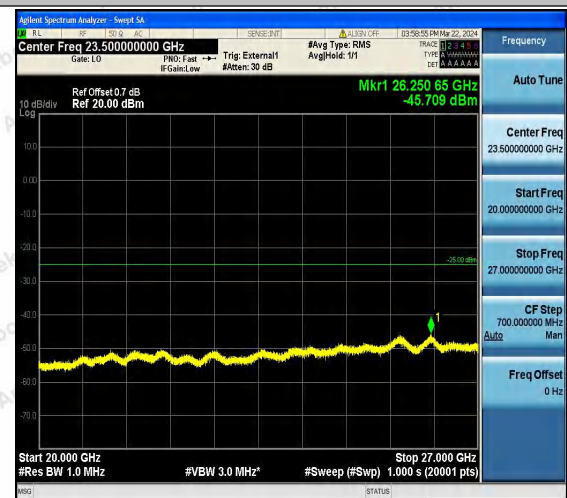


Band41_10MHz_QPSK_40590_1RB#0_20000~27000_20
000~27000



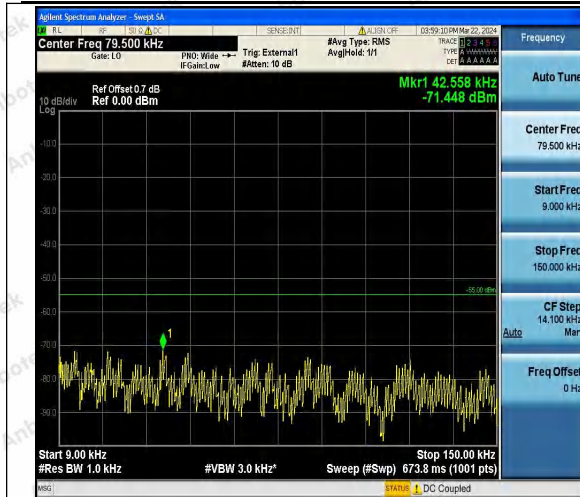


Band41_10MHz_16QAM_40590_1RB#0_0.009~0.15
_0.009~0.15

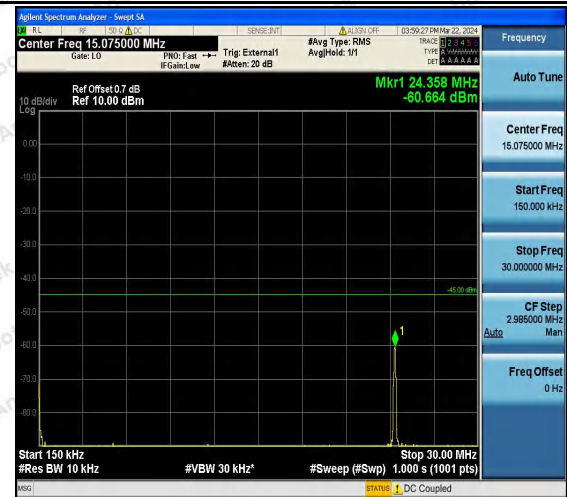


Band41_10MHz_16QAM_40590_1RB#0_0.15~30_0.15~3
0




Band41_10MHz_16QAM_40590_1RB#0_30~1000_3
0~1000

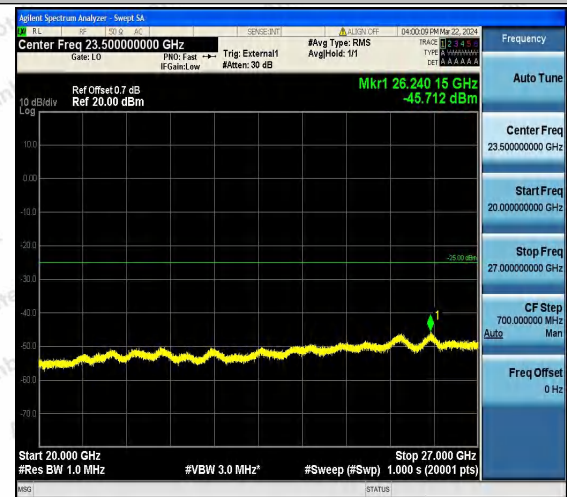

Band41_10MHz_16QAM_40590_1RB#0_20000~27000_2
0000~27000

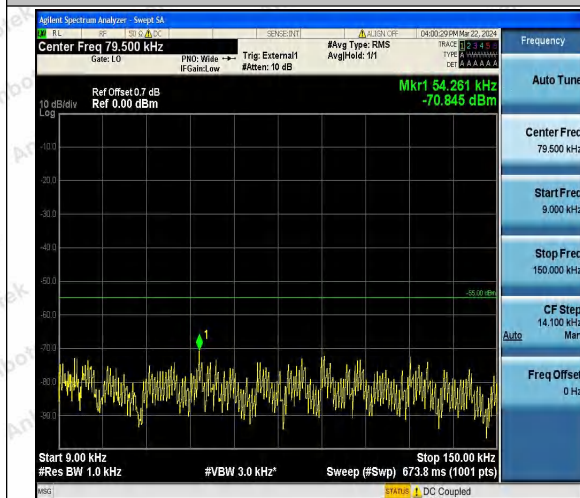


Band41_10MHz_QPSK_41190_1RB#0_0.009~0.15_0
.009~0.15

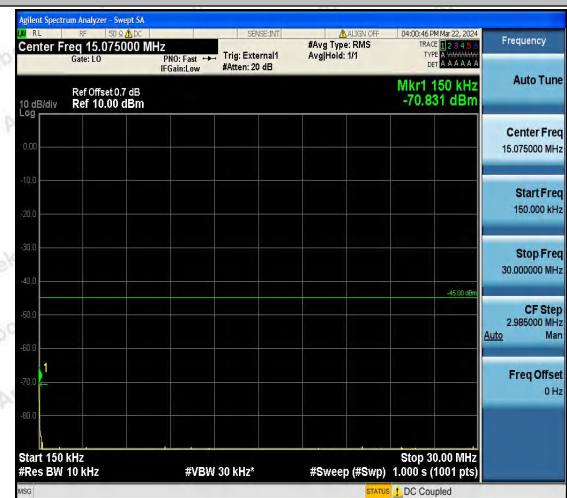


Band41_10MHz_QPSK_41190_1RB#0_0.15~30_0.15~30




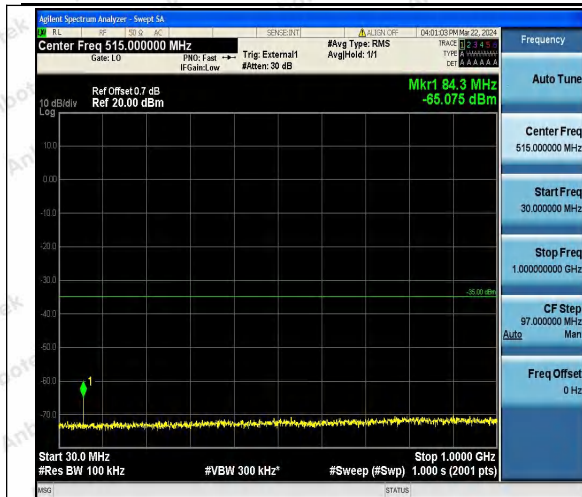


Band41_10MHz_QPSK_41190_1RB#0_30~1000_30~1000

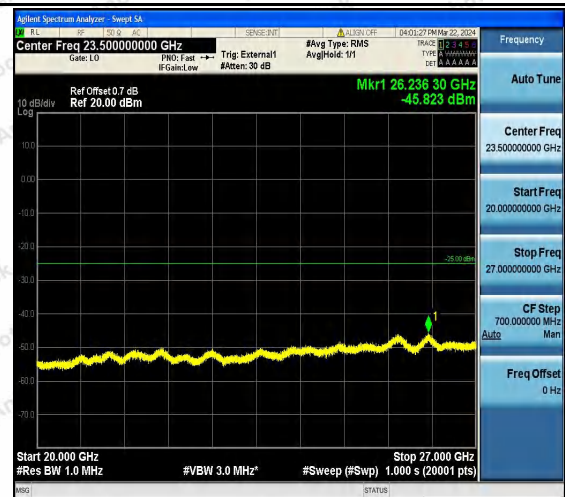


Band41_10MHz_QPSK_41190_1RB#0_20000~27000_20000~27000

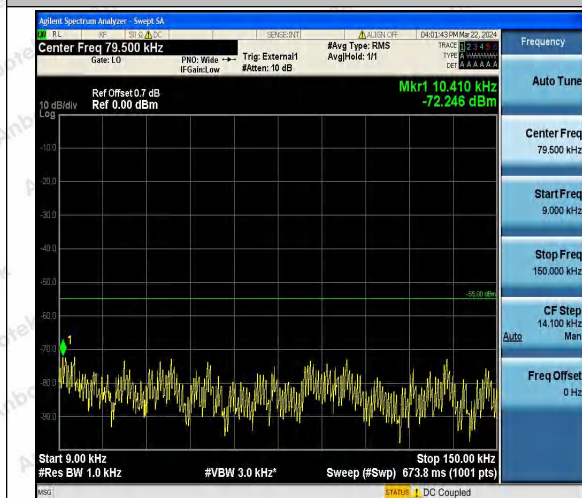


Band41_10MHz_16QAM_41190_1RB#0_0.009~0.15_0.009~0.15

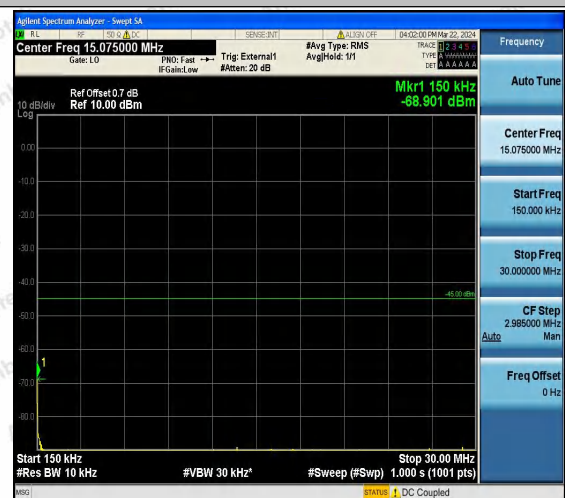

Band41_10MHz_16QAM_41190_1RB#0_0.15~30_0.15~30

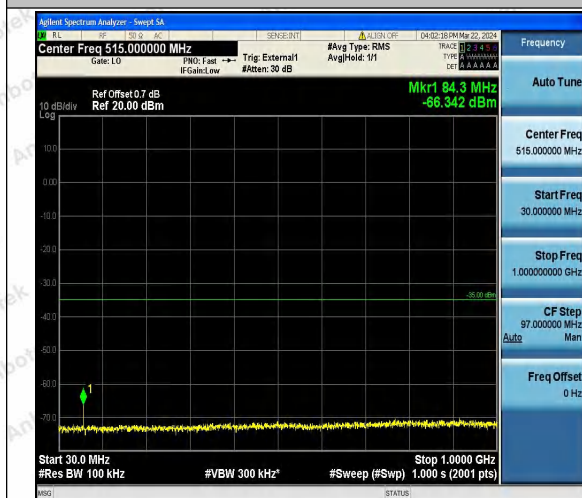


Band41_10MHz_16QAM_41190_1RB#0_30~1000_30~1000

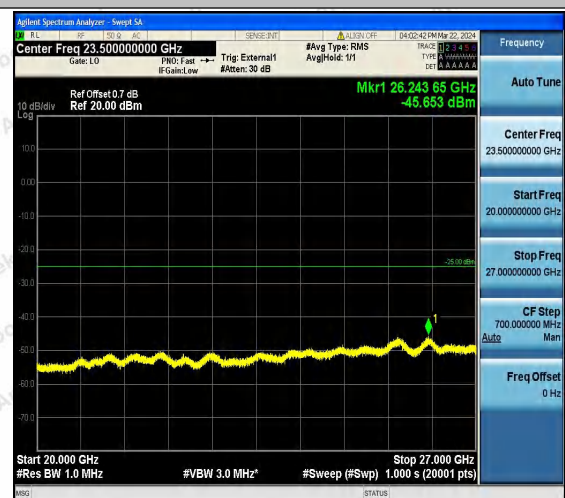


Band41_10MHz_16QAM_41190_1RB#0_20000~27000_20000~27000




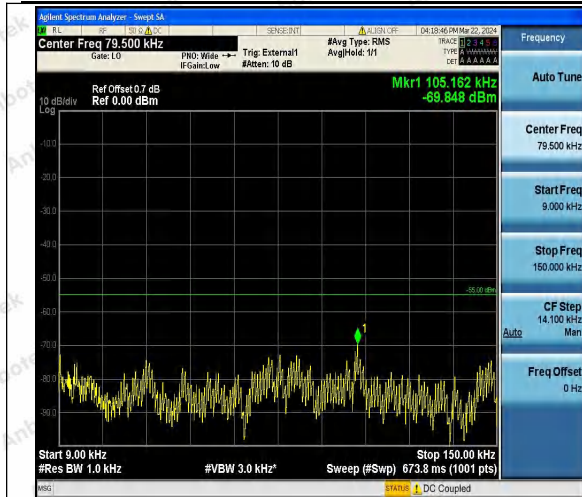


Band41_15MHz_QPSK_40115_1RB#0_0.009~0.15_0
0.009~0.15

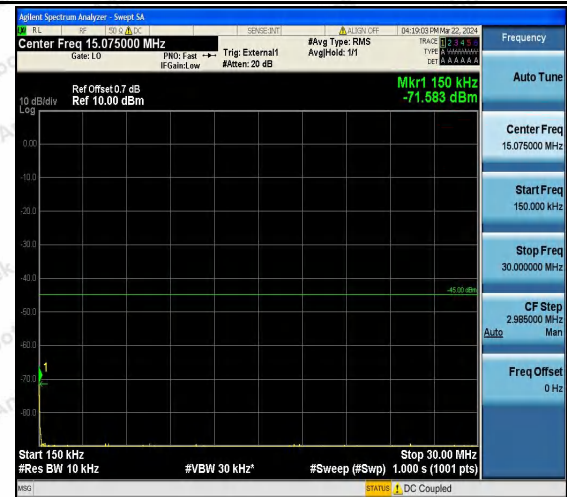


Band41_15MHz_QPSK_40115_1RB#0_0.15~30_0.15~30

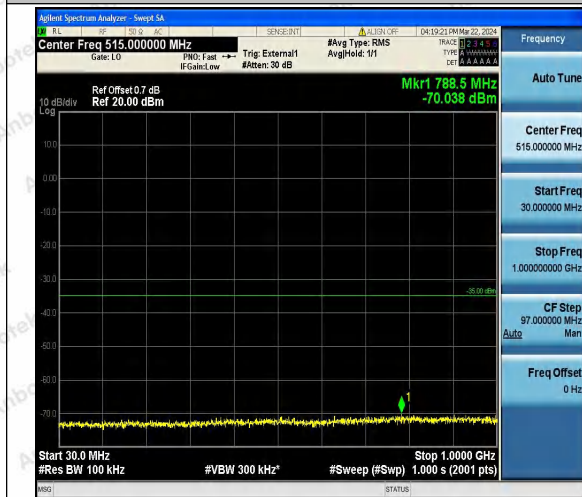


Band41_15MHz_QPSK_40115_1RB#0_30~1000_30~
1000

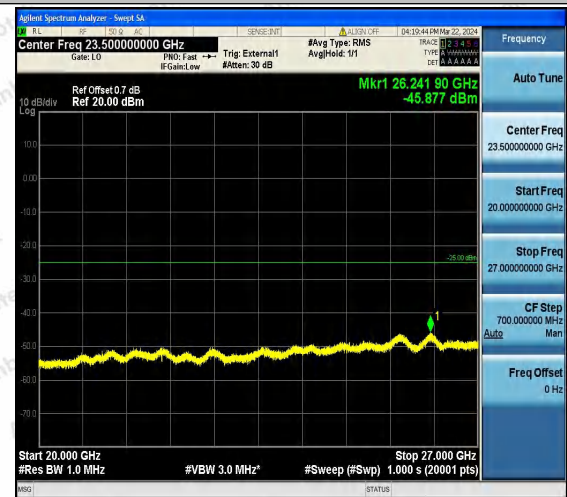

Band41_15MHz_QPSK_40115_1RB#0_20000~27000_20
000~27000

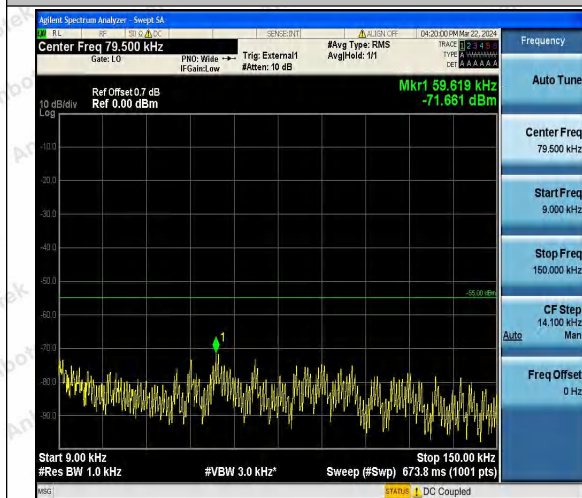

Band41_15MHz_16QAM_40115_1RB#0_0.009~0.15_
0.009~0.15

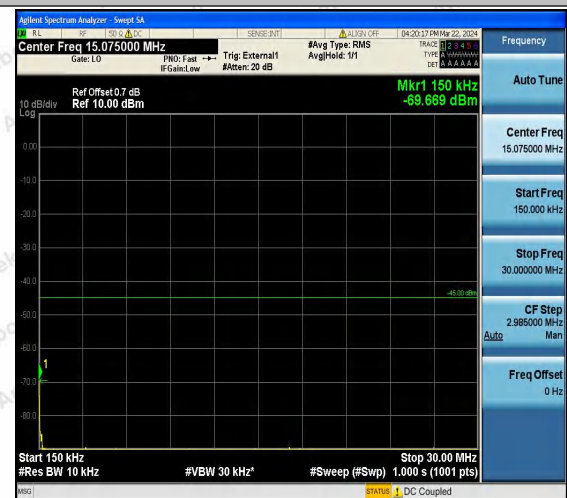


Band41_15MHz_16QAM_40115_1RB#0_0.15~30_0.15~3
0







Band41_15MHz_16QAM_40115_1RB#0_30~1000_30
~1000

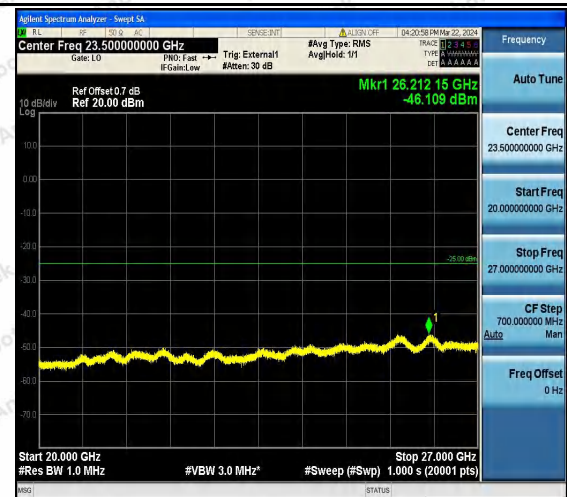

Band41_15MHz_16QAM_40115_1RB#0_20000~27000_2
0000~27000

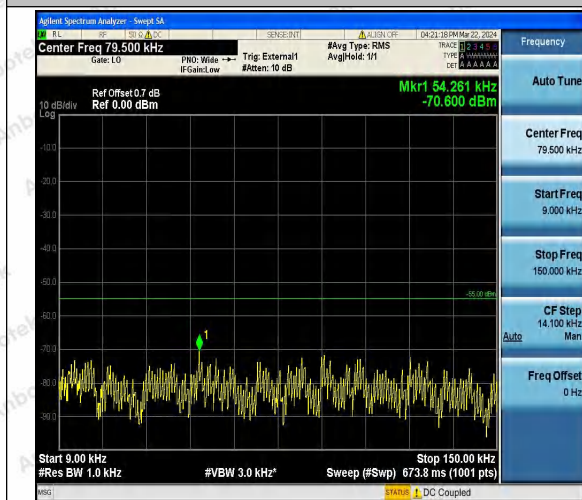


Band41_15MHz_QPSK_40590_1RB#0_0.009~0.15_0.009~0.15

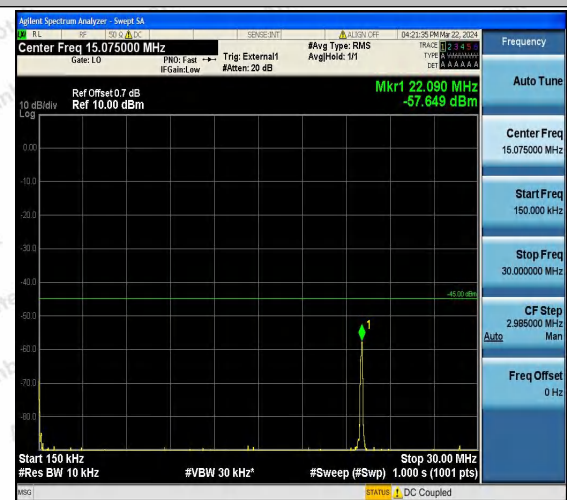

Band41_15MHz_QPSK_40590_1RB#0_0.15~30_0.15~30








Band41_15MHz_QPSK_40590_1RB#0_30~1000_30
~1000

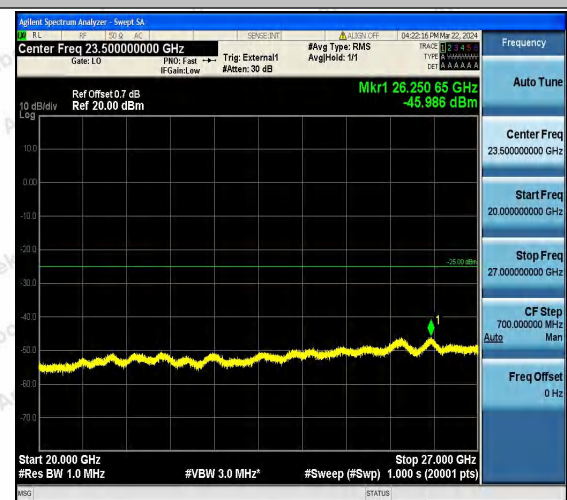

Band41_15MHz_QPSK_40590_1RB#0_20000~27000_20
000~27000

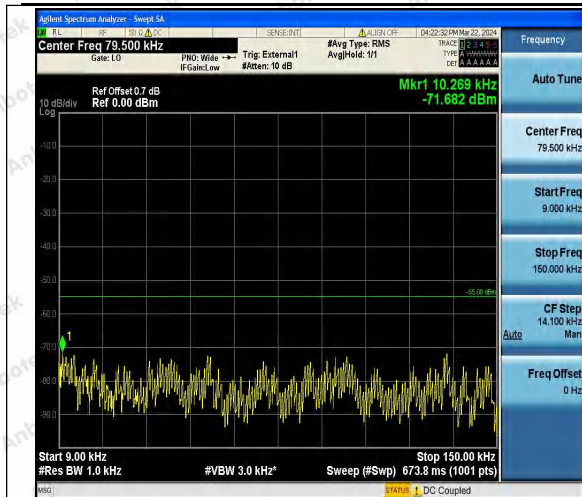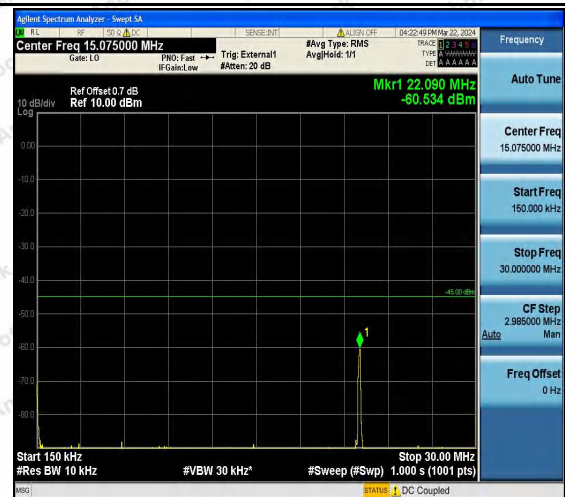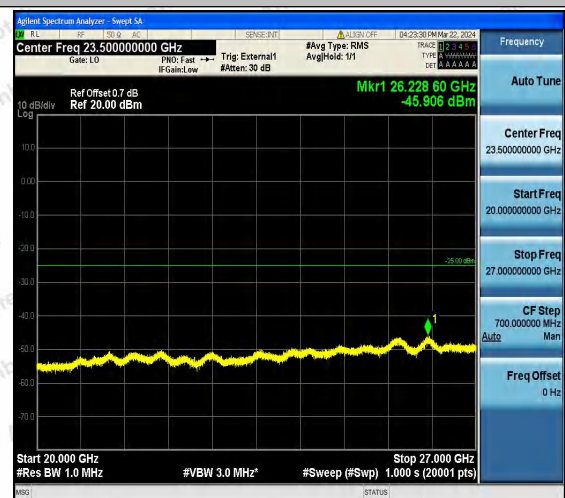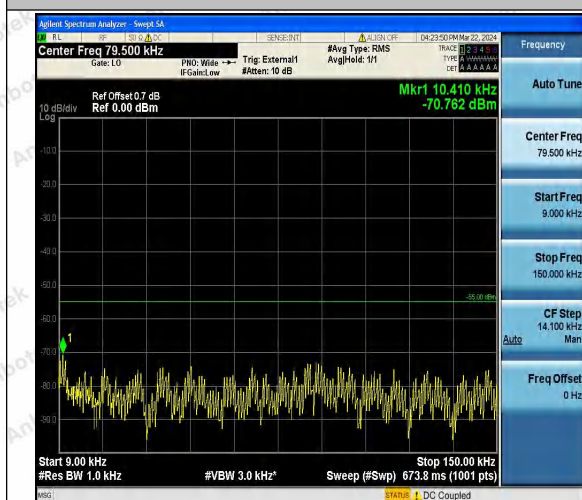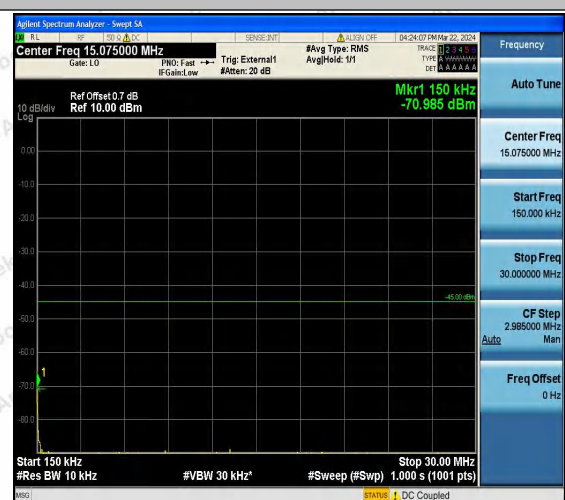


Band41_15MHz_16QAM_40590_1RB#0_0.009~0.15
_0.009~0.15Band41_15MHz_16QAM_40590_1RB#0_0.15~30_0.15~3
0Band41_15MHz_16QAM_40590_1RB#0_30~1000_3
0~1000Band41_15MHz_16QAM_40590_1RB#0_20000~27000_2
0000~27000Band41_15MHz_QPSK_41165_1RB#0_0.009~0.15_0
.009~0.15

Band41_15MHz_QPSK_41165_1RB#0_0.15~30_0.15~30






Band41_15MHz_QPSK_41165_1RB#0_30~1000_30~1000

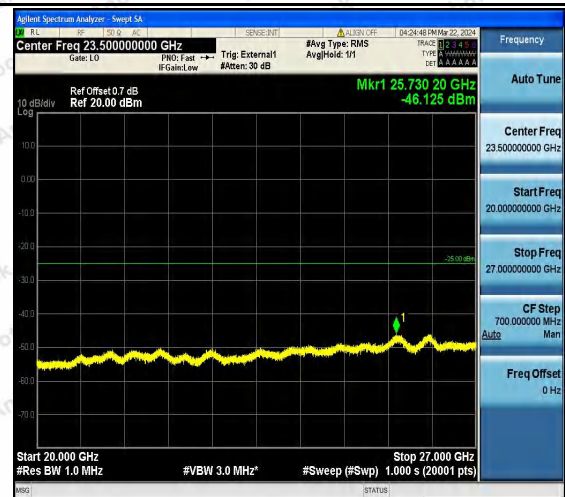


Band41_15MHz_QPSK_41165_1RB#0_20000~27000_20000~27000

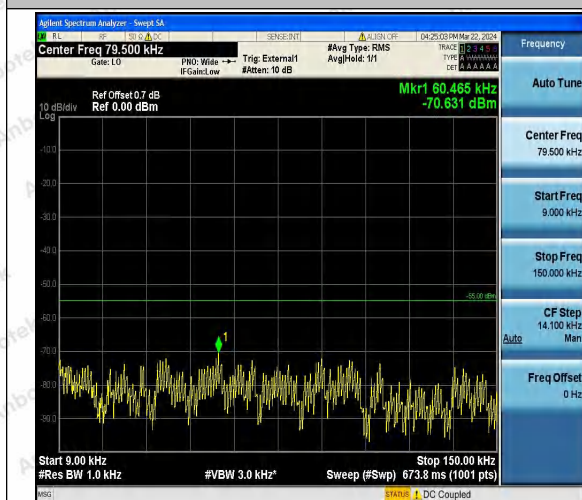


Band41_15MHz_16QAM_41165_1RB#0_0.009~0.15_0.009~0.15



Band41_15MHz_16QAM_41165_1RB#0_0.15~30_0.15~30

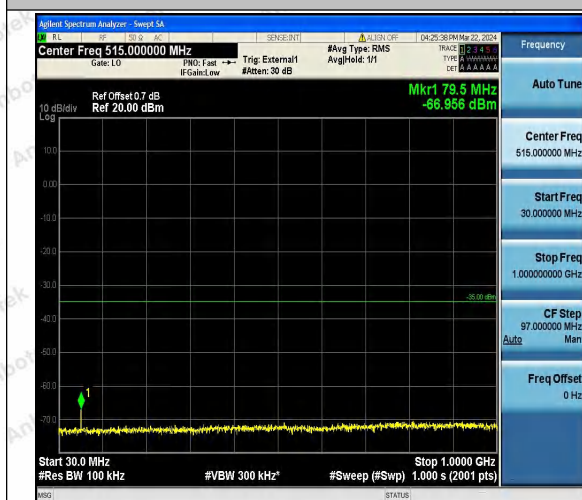

Band41_15MHz_16QAM_41165_1RB#0_30~1000_30~1000

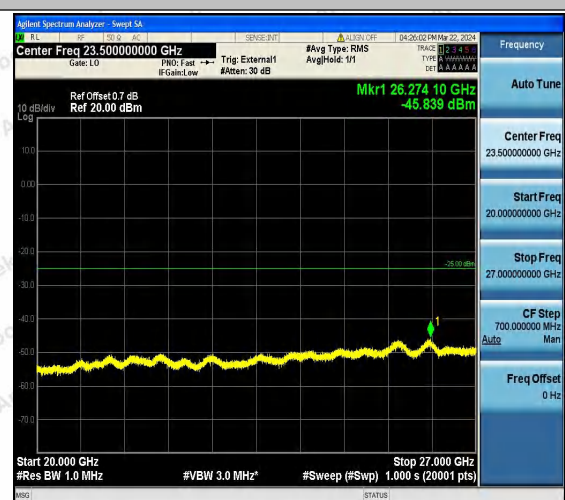


Band41_15MHz_16QAM_41165_1RB#0_20000~27000_20000~27000






Band41_20MHz_QPSK_40140_1RB#0_0.009~0.15_0.009~0.15

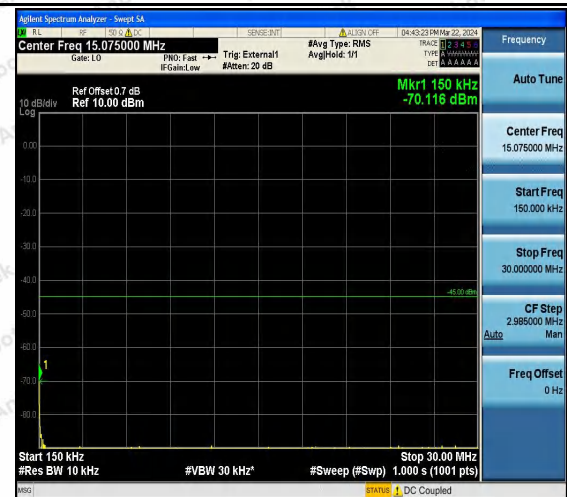


Band41_20MHz_QPSK_40140_1RB#0_0.15~30_0.15~30




Band41_20MHz_QPSK_40140_1RB#0_30~1000_30~1000

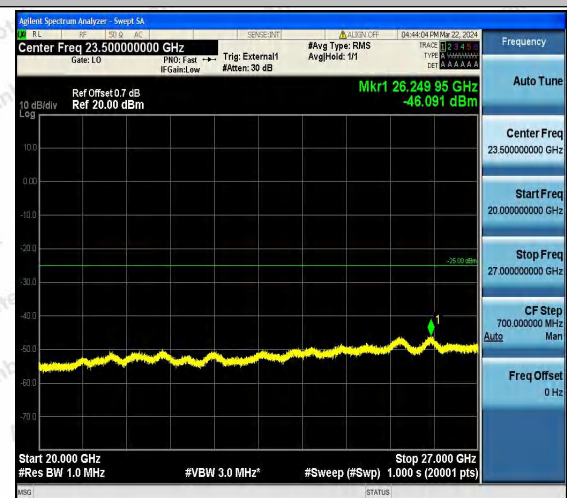

Band41_20MHz_QPSK_40140_1RB#0_20000~27000_20000~27000

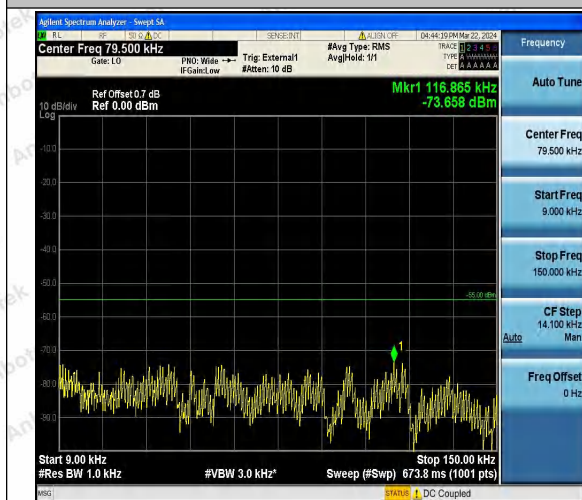

Band41_20MHz_16QAM_40140_1RB#0_0.009~0.15_0.009~0.15

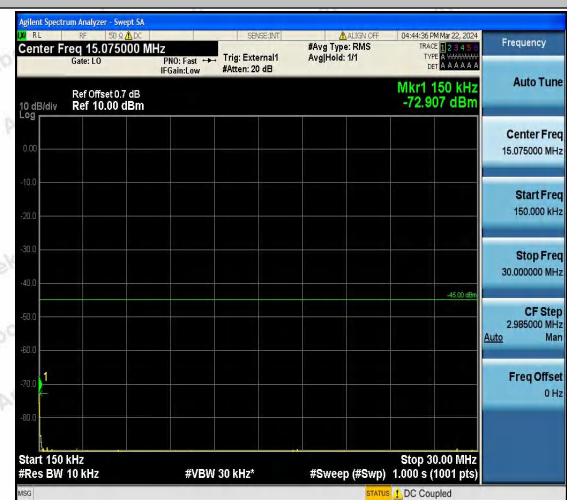


Band41_20MHz_16QAM_40140_1RB#0_0.15~30_0.15~30







Band41_20MHz_16QAM_40140_1RB#0_30~1000_3
0~1000

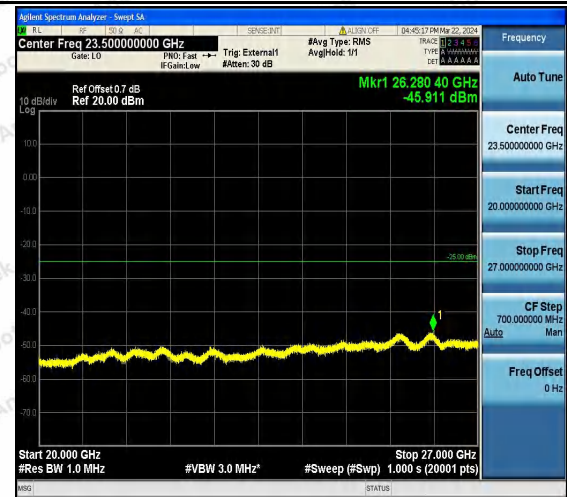

Band41_20MHz_16QAM_40140_1RB#0_20000~27000_2
0000~27000

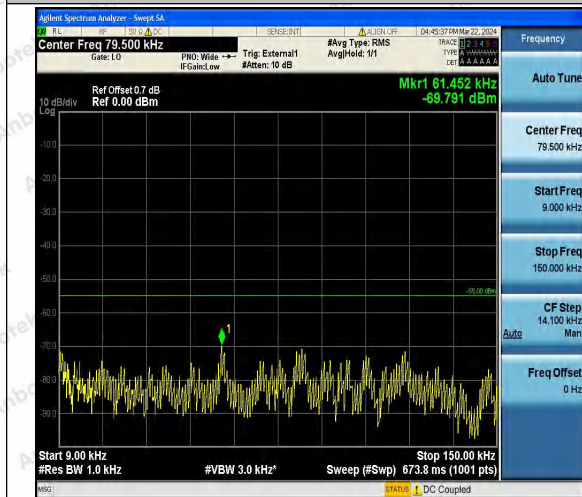


Band41_20MHz_QPSK_40590_1RB#0_0.009~0.15_2
0.009~0.15

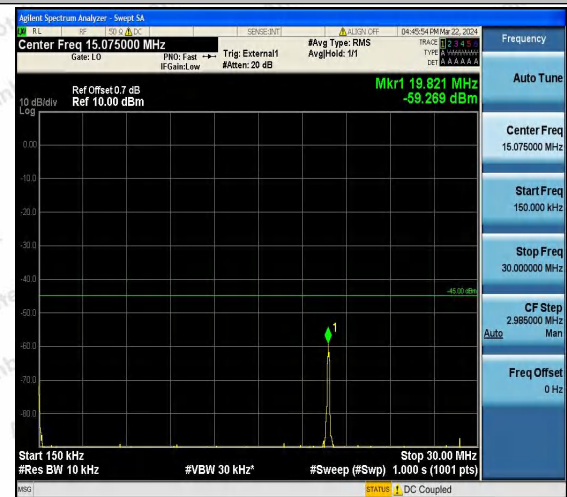

Band41_20MHz_QPSK_40590_1RB#0_0.15~30_0.15~30



Band41_20MHz_QPSK_40590_1RB#0_30~1000_30
~1000

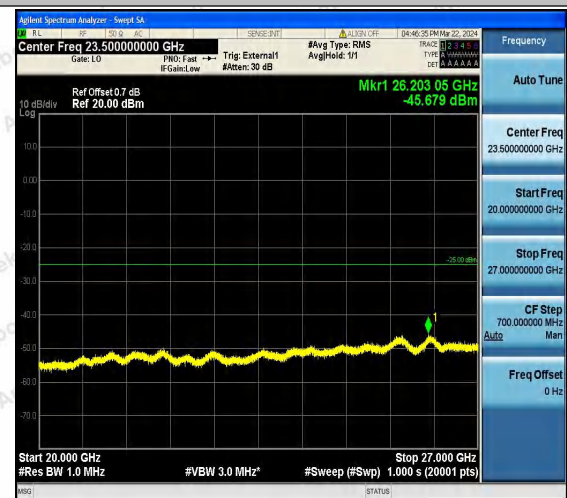


Band41_20MHz_QPSK_40590_1RB#0_20000~27000_20
000~27000





Band41_20MHz_16QAM_40590_1RB#0_0.009~0.15
_0.009~0.15

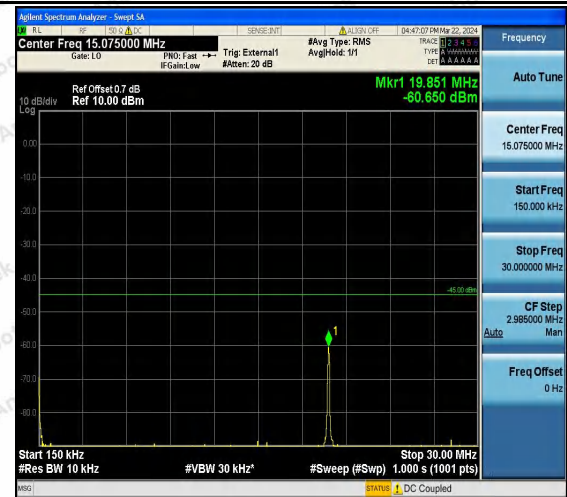


Band41_20MHz_16QAM_40590_1RB#0_0.15~30_0.15~3
0




Band41_20MHz_16QAM_40590_1RB#0_30~1000_3
0~1000



Band41_20MHz_16QAM_40590_1RB#0_20000~27000_2
0000~27000

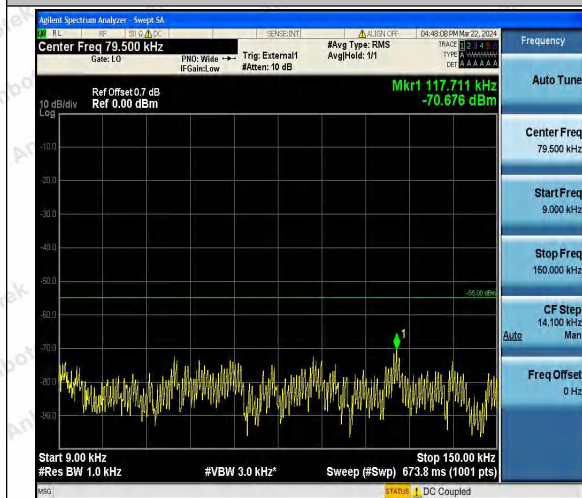

Band41_20MHz_QPSK_41140_1RB#0_0.009~0.15_0
.009~0.15

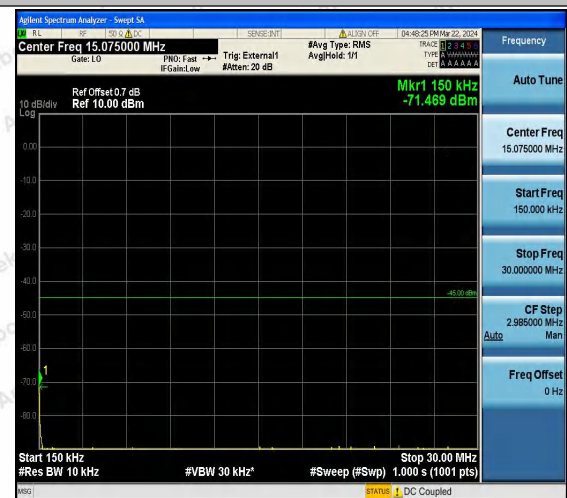


Band41_20MHz_QPSK_41140_1RB#0_0.15~30_0.15~30







Band41_20MHz_QPSK_41140_1RB#0_30~1000_30~1000

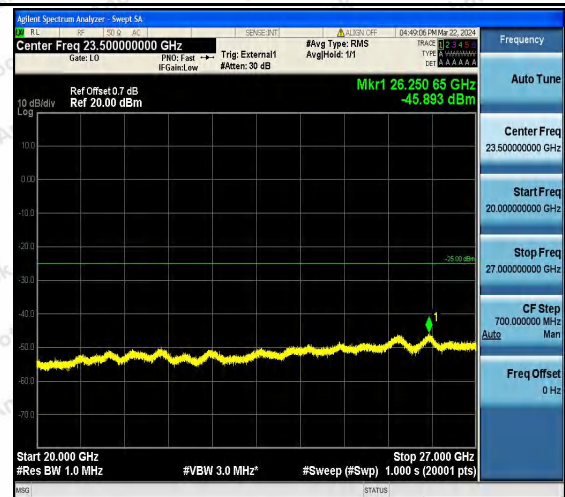


Band41_20MHz_QPSK_41140_1RB#0_20000~27000_20000~27000

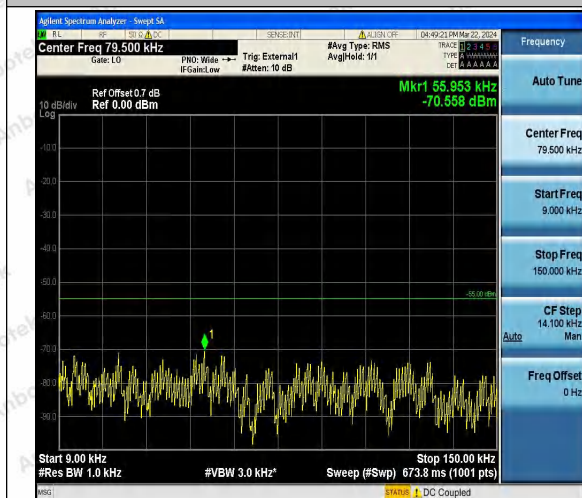

Band41_20MHz_16QAM_41140_1RB#0_0.009~0.15_0.009~0.15

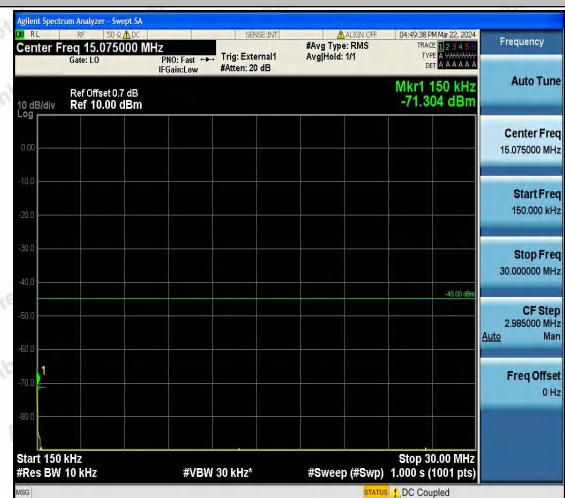

Band41_20MHz_16QAM_41140_1RB#0_0.15~30_0.15~30

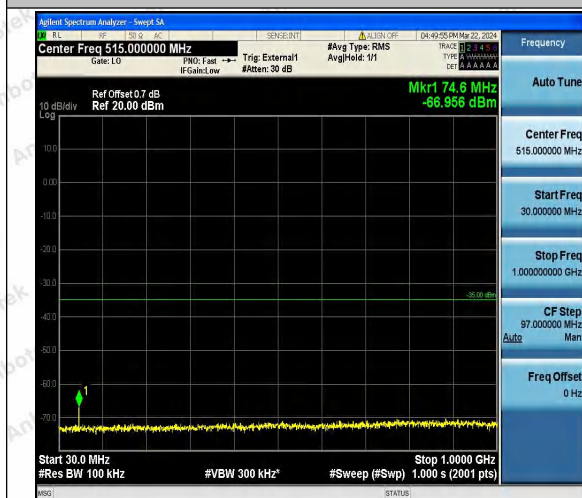

Band41_20MHz_16QAM_41140_1RB#0_30~1000_30~1000



Band41_20MHz_16QAM_41140_1RB#0_20000~27000_20000~27000



Appendix F: Frequency stability VS Voltage measurement

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
41(2535-2655)	5MHz	QPSK	40065	25RB#0	VN	NT	-7.05	-0.002778	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	VL	NT	-7.62	-0.003003	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	VH	NT	-6.71	-0.002644	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	VN	NT	-4.94	-0.001947	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	VL	NT	5.58	0.002199	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	VH	NT	9.61	0.003787	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	VN	NT	-9.73	-0.003757	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	VL	NT	-10.84	-0.004185	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	VH	NT	9.83	0.003795	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	VN	NT	-11.89	-0.004591	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	VL	NT	7.11	0.002745	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	VH	NT	-4.35	-0.001680	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	VN	NT	-8.80	-0.003318	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	VL	NT	-7.64	-0.002880	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	VH	NT	-10.49	-0.003955	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	VN	NT	10.76	0.004057	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	VL	NT	-10.29	-0.003879	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	VH	NT	-8.38	-0.003159	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	VN	NT	-9.11	-0.003587	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	VL	NT	-9.56	-0.003764	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	VH	NT	-5.91	-0.002327	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	VN	NT	7.14	0.002757	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	VL	NT	-10.34	-0.003992	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	VH	NT	-11.97	-0.004622	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	VN	NT	-9.43	-0.003558	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	VL	NT	-7.37	-0.002781	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	VH	NT	-8.30	-0.003132	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	VN	NT	-10.00	-0.003933	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	VL	NT	7.05	0.002773	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	VH	NT	11.92	0.004688	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	VN	NT	-12.62	-0.004873	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	VL	NT	8.96	0.003459	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	VH	NT	-9.10	-0.003514	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	VN	NT	-6.52	-0.002463	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	VL	NT	7.91	0.002988	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



41(2535-2655)	15MHz	QPSK	41165	75RB#0	VH	NT	-8.43	-0.003184	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	VN	NT	-8.60	-0.003379	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	VL	NT	6.59	0.002589	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	VH	NT	-4.71	-0.001851	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	VN	NT	-10.94	-0.004224	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	VL	NT	-9.93	-0.003834	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	VH	NT	9.14	0.003529	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	VN	NT	-6.12	-0.002314	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	VL	NT	-14.26	-0.005391	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	VH	NT	-3.93	-0.001486	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix G: Frequency stability VS Temperature measurement

Test Result

Band	Bandwidth	Modulation	Channel	Temperature						
				RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	-30	-5.59	-0.002203	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	-20	6.71	0.002644	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	-10	10.19	0.004016	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	0	8.77	0.003456	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	10	7.84	0.003090	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	20	10.40	0.004099	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	30	9.16	0.003610	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	40	5.59	0.002203	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	50	-7.24	-0.002853	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	-30	9.20	0.003626	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	-20	10.46	0.004122	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	-10	3.82	0.001505	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	0	4.36	0.001718	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	10	9.24	0.003641	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	20	-10.59	-0.004173	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	30	8.90	0.003507	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	40	7.98	0.003145	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	50	9.44	0.003720	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	-30	-9.60	-0.003707	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	-20	-9.44	-0.003645	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	-10	-13.85	-0.005347	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	0	-8.40	-0.003243	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	10	-9.41	-0.003633	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	20	-8.54	-0.003297	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	30	-11.46	-0.004425	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	40	-6.07	-0.002344	±2.5	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	50	-6.77	-0.002614	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	-30	6.25	0.002413	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	-20	-7.34	-0.002834	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	-10	9.66	0.003730	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	0	-10.31	-0.003981	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	10	7.72	0.002981	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	20	-9.64	-0.003722	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	30	11.66	0.004502	±2.5	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	40	8.94	0.003452	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	50	5.75	0.002220	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	-30	-10.74	-0.004049	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	-20	-10.99	-0.004143	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	-10	-6.61	-0.002492	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	0	-7.82	-0.002948	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	10	4.55	0.001715	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	20	-10.60	-0.003996	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	30	-12.52	-0.004720	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	40	-7.61	-0.002869	±2.5	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	50	-7.24	-0.002730	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	-30	-7.84	-0.002956	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	-20	-9.04	-0.003408	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	-10	-8.00	-0.003016	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	0	-4.13	-0.001557	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	10	-7.88	-0.002971	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	20	-10.07	-0.003796	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	30	-8.35	-0.003148	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	40	5.38	0.002028	±2.5	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	50	12.97	0.004890	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	-30	-7.14	-0.002811	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	-20	6.57	0.002587	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	-10	5.88	0.002315	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	0	-10.64	-0.004189	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	10	6.45	0.002539	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	20	8.51	0.003350	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	30	9.31	0.003665	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	40	7.54	0.002969	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	50	10.30	0.004055	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	-30	-8.54	-0.003297	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	-20	10.70	0.004131	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	-10	-7.27	-0.002807	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	0	-13.50	-0.005212	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	10	-10.60	-0.004093	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	20	-10.01	-0.003865	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	30	-12.47	-0.004815	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	40	-2.73	-0.001054	±2.5	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	50	-8.40	-0.003243	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	-30	7.05	0.002660	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	-20	8.67	0.003272	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	-10	-13.02	-0.004913	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	0	-7.60	-0.002868	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	10	-10.37	-0.003913	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	20	-6.27	-0.002366	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	30	-7.42	-0.002800	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	40	5.66	0.002136	±2.5	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	50	-8.58	-0.003238	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	-30	6.08	0.002391	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	-20	-7.58	-0.002981	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	-10	-9.66	-0.003799	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	0	-10.04	-0.003949	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	10	7.02	0.002761	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	20	9.77	0.003843	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	30	-3.68	-0.001447	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	40	5.68	0.002234	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	50	-9.54	-0.003752	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	-30	10.23	0.003950	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	-20	-9.17	-0.003541	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	-10	9.06	0.003498	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	0	12.10	0.004672	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	10	-7.35	-0.002838	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	20	-12.46	-0.004811	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	30	-6.39	-0.002467	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	40	-6.31	-0.002436	±2.5	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	50	-8.18	-0.003158	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	-30	-7.54	-0.002848	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	-20	-6.51	-0.002459	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	-10	-8.85	-0.003343	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	0	8.67	0.003275	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	10	5.39	0.002036	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	20	-6.81	-0.002572	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	30	-6.64	-0.002508	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	40	7.21	0.002723	±2.5	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	50	-6.25	-0.002361	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	-30	4.72	0.001855	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	-20	-4.63	-0.001819	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	-10	5.95	0.002338	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	0	-3.40	-0.001336	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	10	4.62	0.001815	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	20	4.91	0.001929	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	30	-3.95	-0.001552	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	40	7.07	0.002778	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	50	-4.02	-0.001580	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	-30	-9.58	-0.003699	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	-20	-8.70	-0.003359	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	-10	-10.61	-0.004097	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	0	-7.91	-0.003054	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	10	-6.84	-0.002641	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	20	6.55	0.002529	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	30	9.58	0.003699	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	40	-8.78	-0.003390	±2.5	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	50	-4.49	-0.001734	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	-30	-11.09	-0.004193	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	-20	-6.98	-0.002639	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	-10	-9.31	-0.003520	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	0	-5.14	-0.001943	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	10	-5.68	-0.002147	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	20	-8.75	-0.003308	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	30	4.72	0.001784	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	40	10.01	0.003784	±2.5	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	50	-6.68	-0.002526	±2.5	PASS

---END---

