






Band38-5MHz-QPSK-38225-25RB#0-PASS

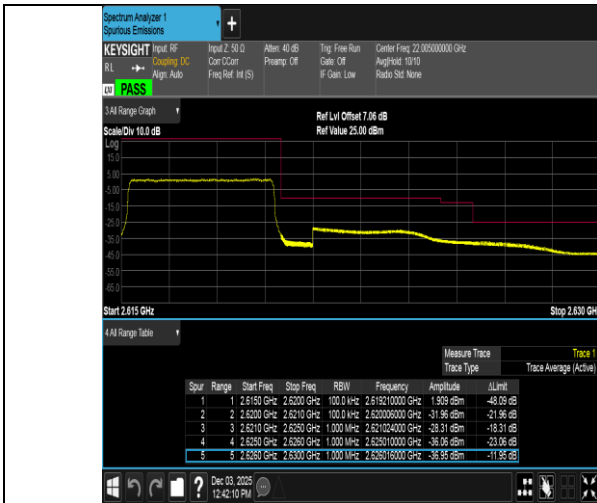

Band38-5MHz-16QAM-38225-1RB#0-PASS

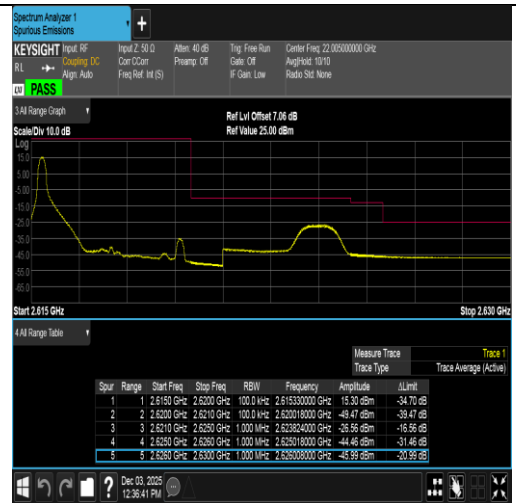


Band38-5MHz-16QAM-38225-1RB#24-PASS

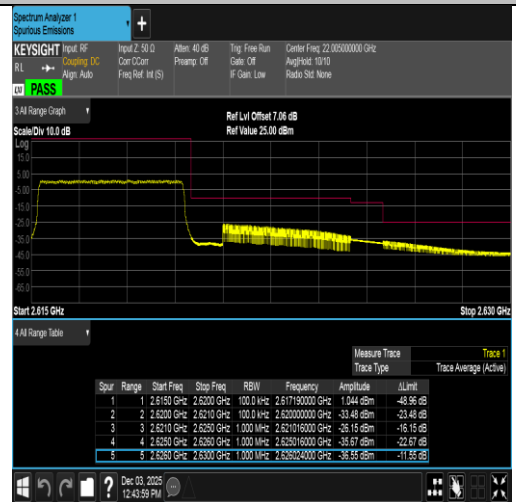

Band38-5MHz-16QAM-38225-25RB#0-PASS




Band38-10MHz-QPSK-37800-1RB#0-PASS

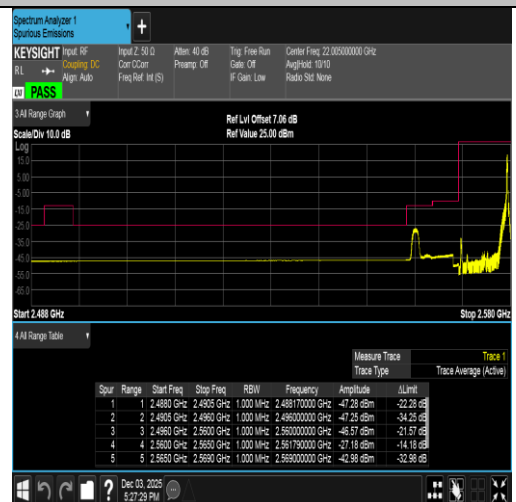


Band38-10MHz-QPSK-37800-1RB#49-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

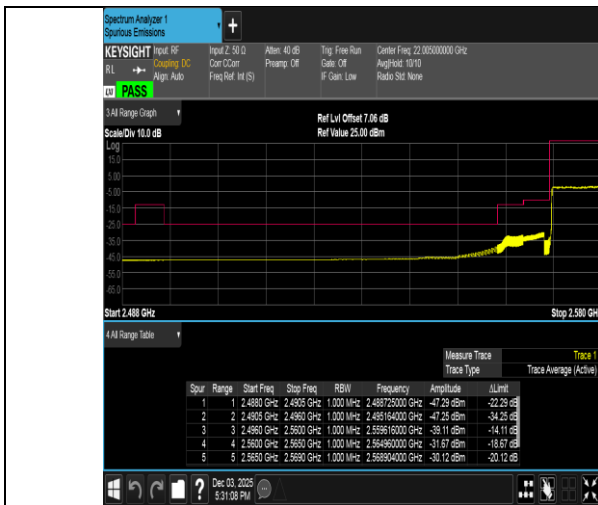


Band38-10MHz-QPSK-37800-50RB#0-PASS

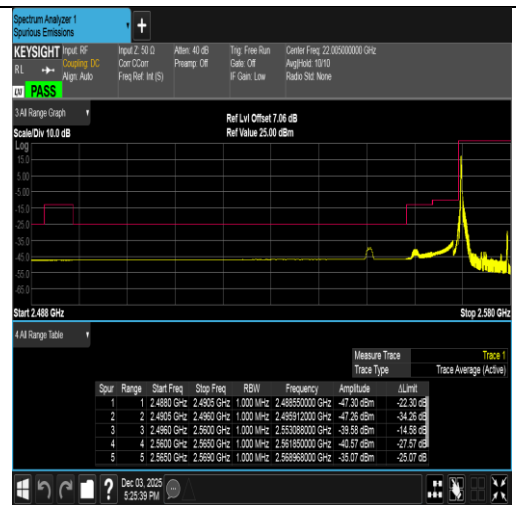


Band38-10MHz-16QAM-37800-1RB#0-PASS

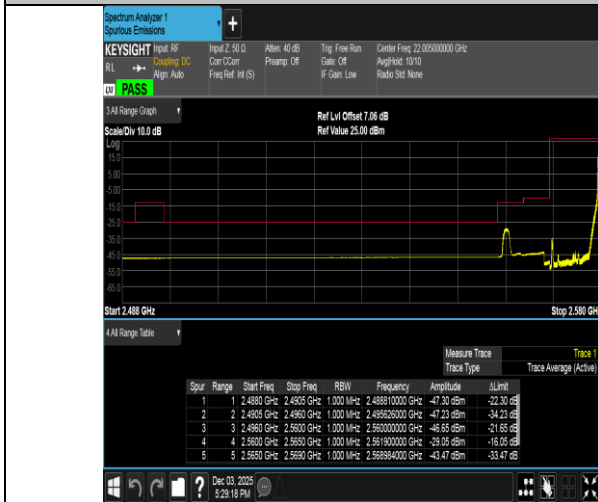


Band38-10MHz-16QAM-37800-1RB#49-PASS

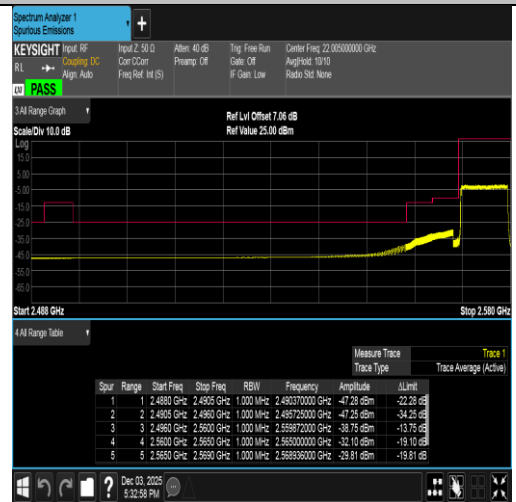

Band38-10MHz-16QAM-37800-50RB#0-PASS

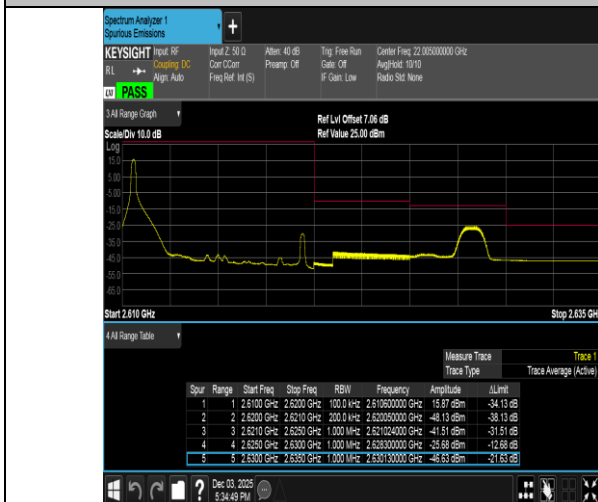


Band38-10MHz-QPSK-38200-1RB#0-PASS

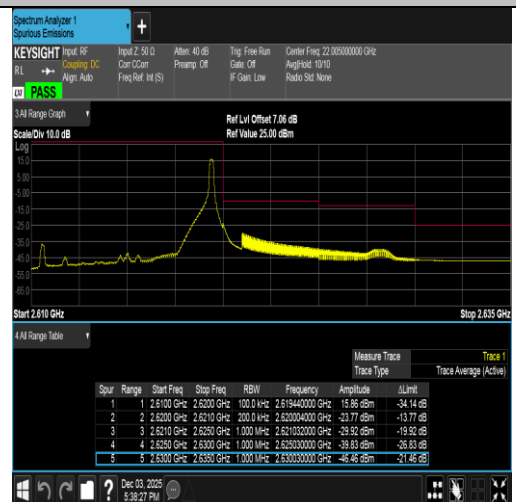


Band38-10MHz-QPSK-38200-1RB#49-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

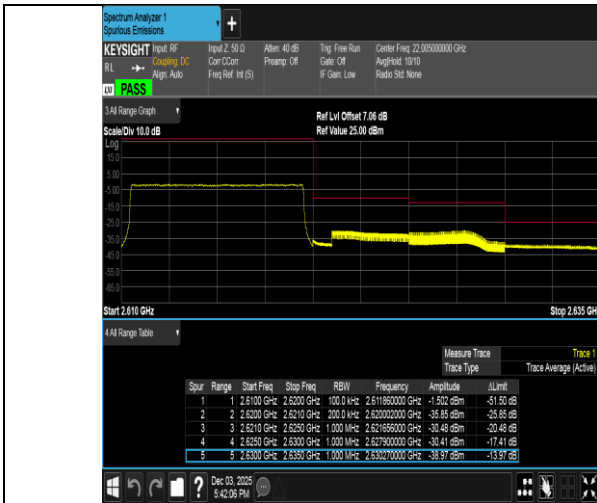


Band38-10MHz-QPSK-38200-50RB#0-PASS

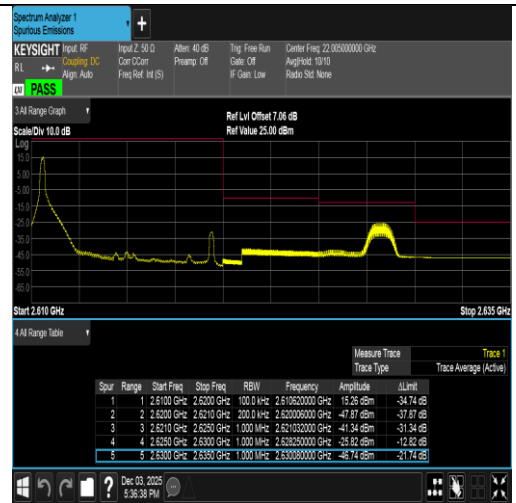


Band38-10MHz-16QAM-38200-1RB#0-PASS

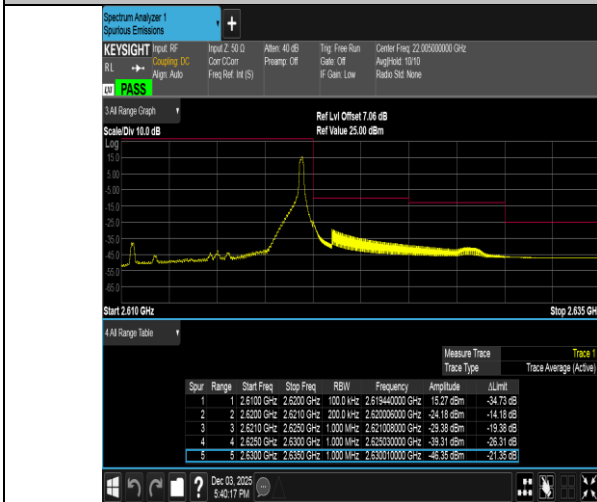


Band38-10MHz-16QAM-38200-1RB#49-PASS

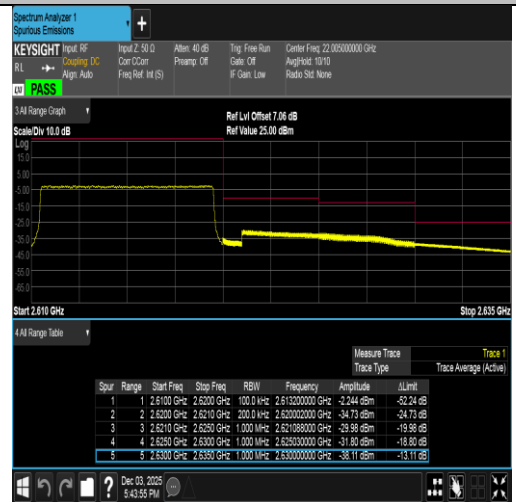

Band38-10MHz-16QAM-38200-50RB#0-PASS

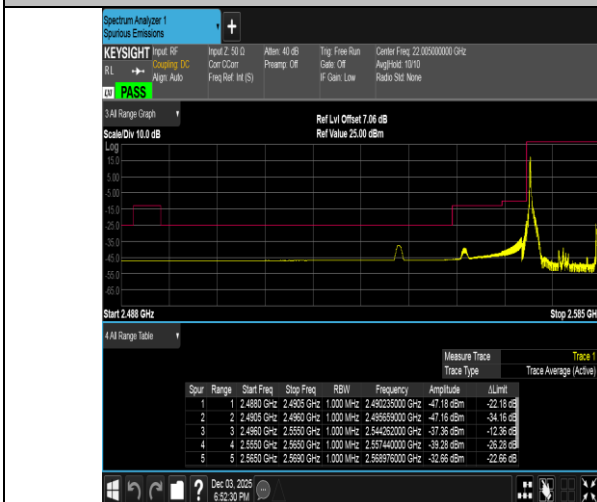


Band38-15MHz-QPSK-37825-1RB#0-PASS

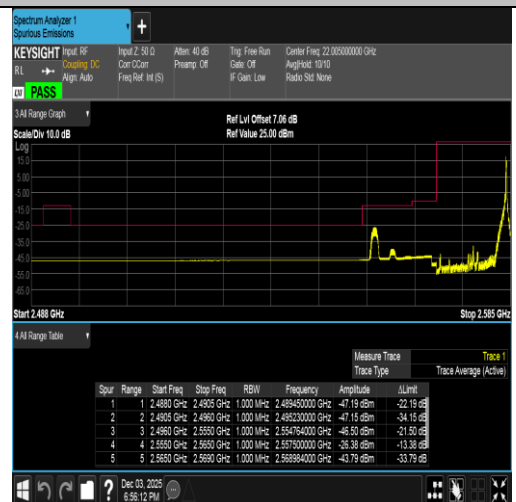


Band38-15MHz-QPSK-37825-1RB#74-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

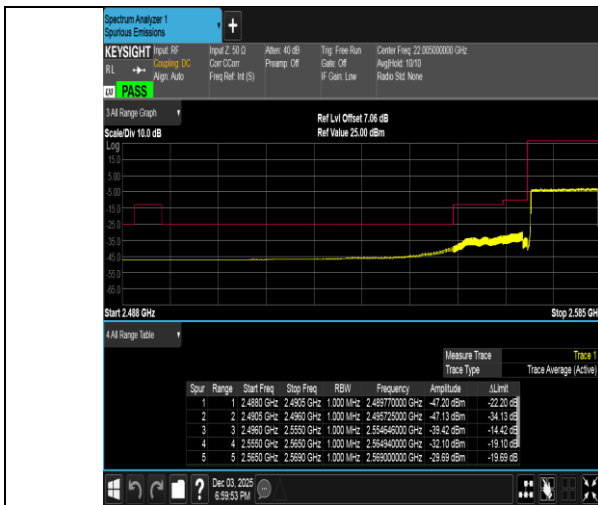

Band38-15MHz-QPSK-37825-75RB#0-PASS

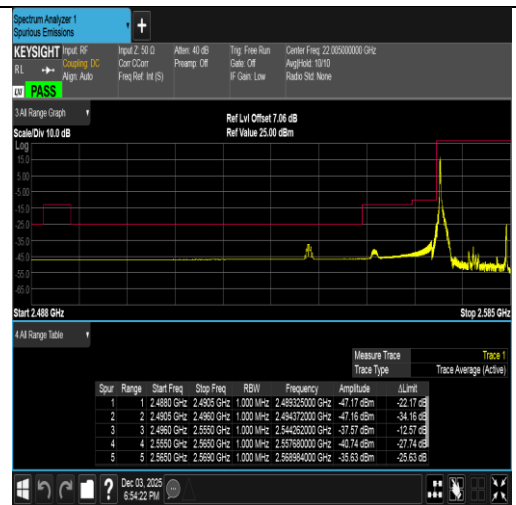


Band38-15MHz-16QAM-37825-1RB#0-PASS

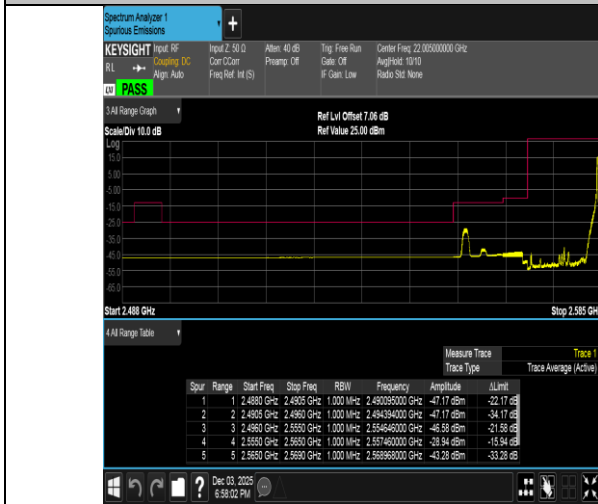


Band38-15MHz-16QAM-37825-1RB#74-PASS



Band38-15MHz-16QAM-37825-75RB#0-PASS

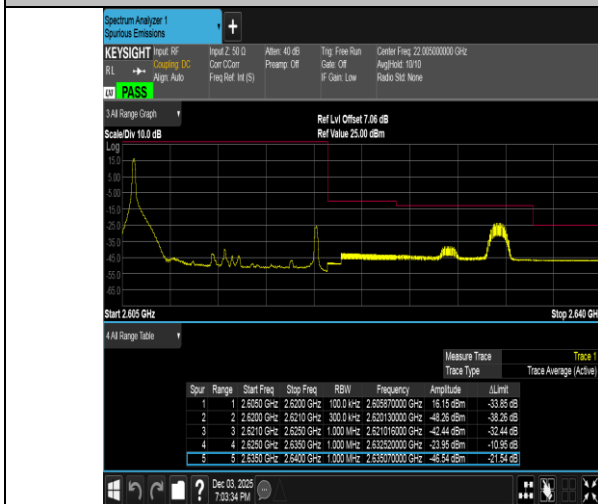

Band38-15MHz-QPSK-38175-1RB#0-PASS

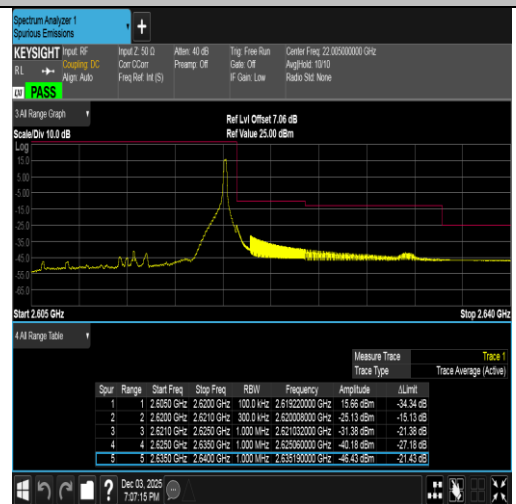


Band38-15MHz-QPSK-38175-1RB#74-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




Band38-15MHz-QPSK-38175-75RB#0-PASS

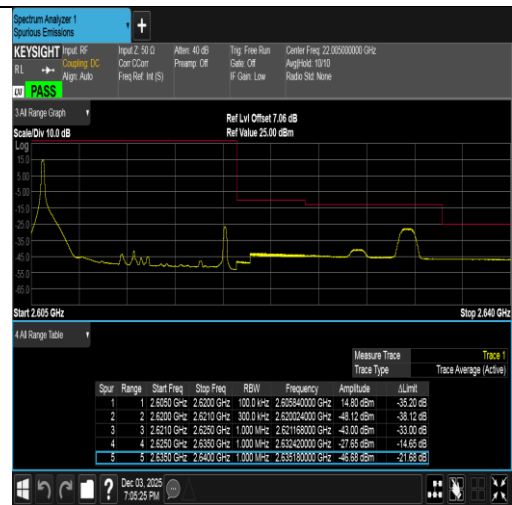


Band38-15MHz-16QAM-38175-1RB#0-PASS

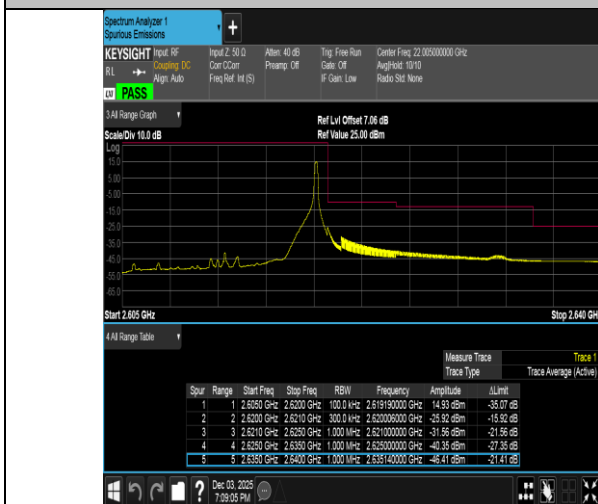


Band38-15MHz-16QAM-38175-1RB#74-PASS

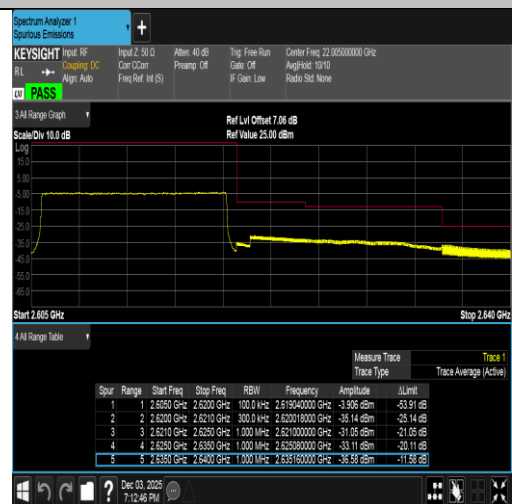

Band38-15MHz-16QAM-38175-75RB#0-PASS

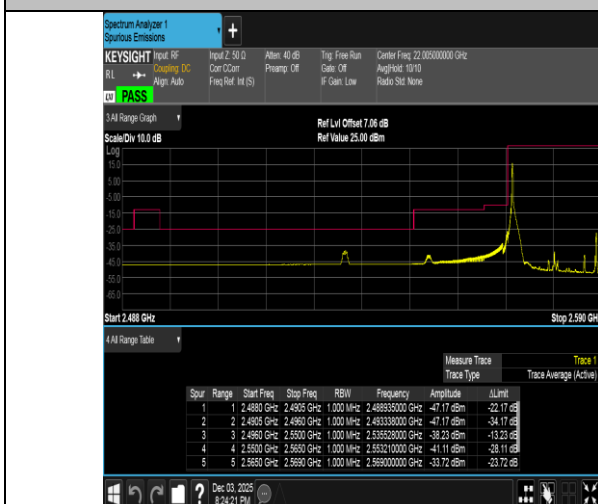


Band38-20MHz-QPSK-37850-1RB#0-PASS

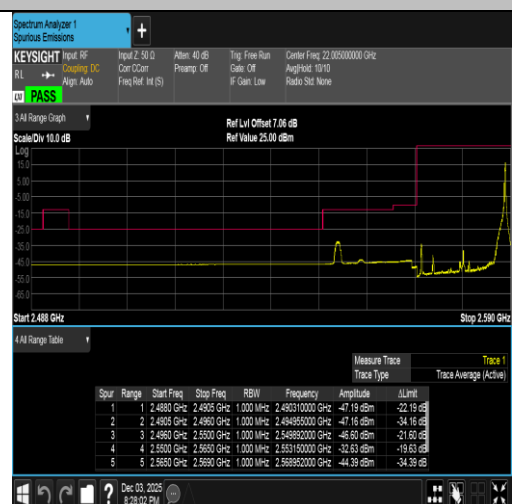


Band38-20MHz-QPSK-37850-1RB#99-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

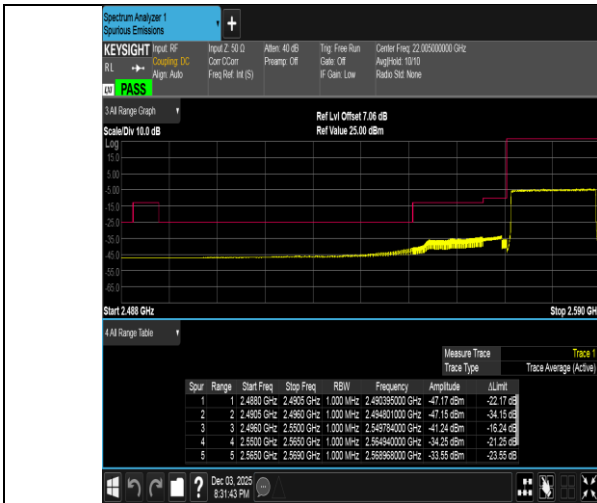


Band38-20MHz-QPSK-37850-100RB#0-PASS

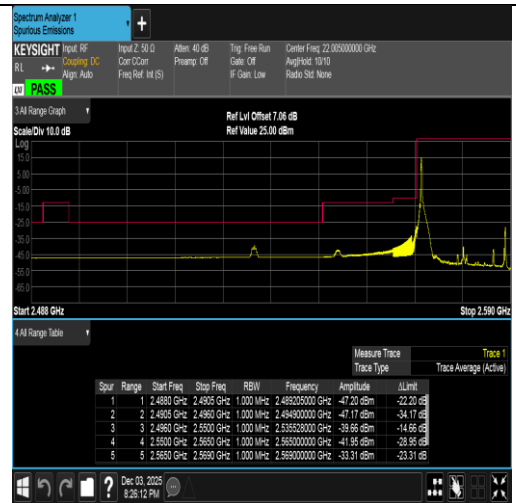


Band38-20MHz-16QAM-37850-1RB#0-PASS

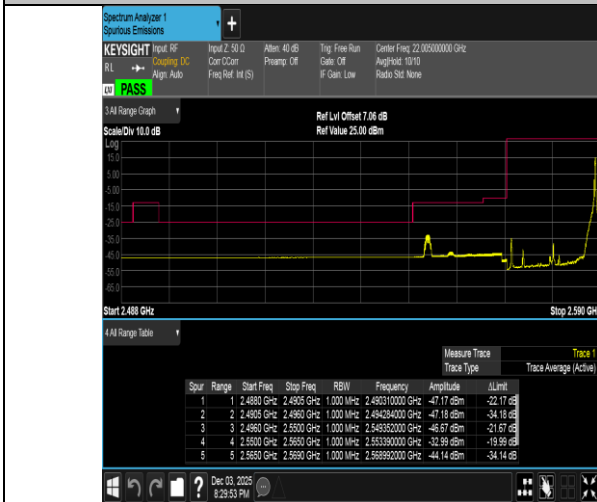


Band38-20MHz-16QAM-37850-1RB#99-PASS

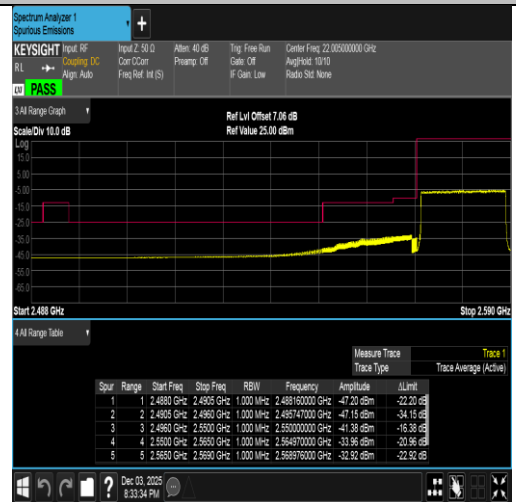

Band38-20MHz-16QAM-37850-100RB#0-PASS

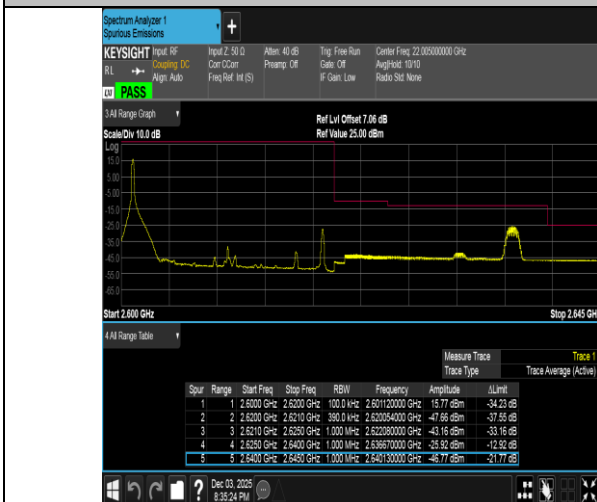


Band38-20MHz-QPSK-38150-1RB#0-PASS

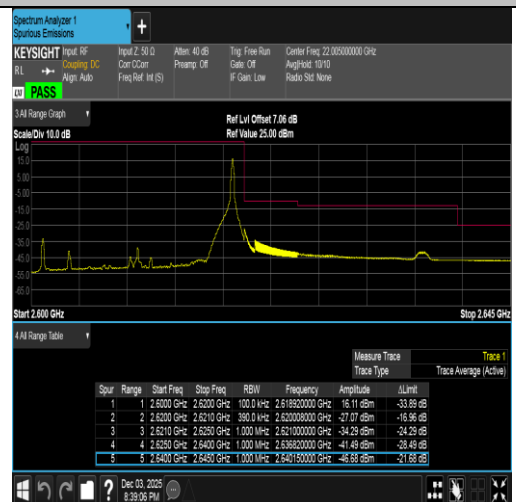


Band38-20MHz-QPSK-38150-1RB#99-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

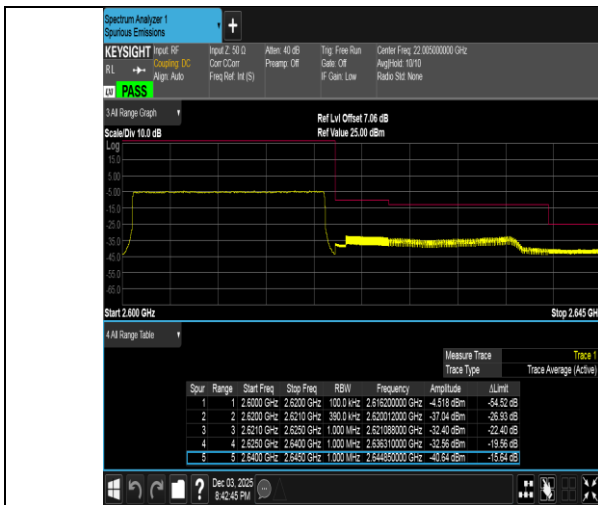


Band38-20MHz-QPSK-38150-100RB#0-PASS

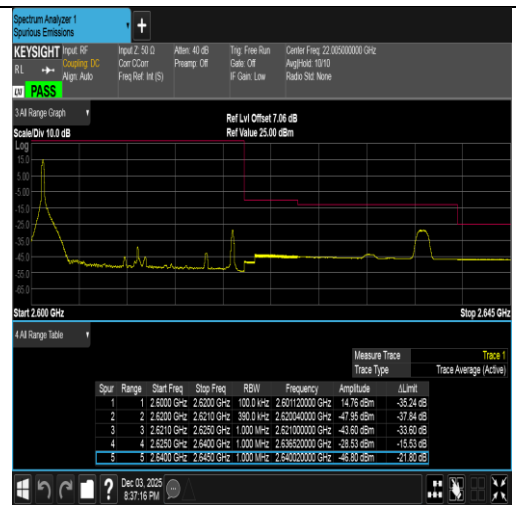

Band38-20MHz-16QAM-38150-1RB#0-PASS

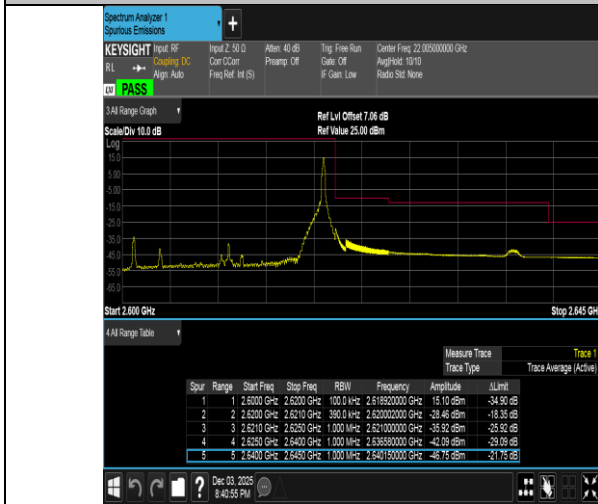

Band38-20MHz-16QAM-38150-1RB#99-PASS

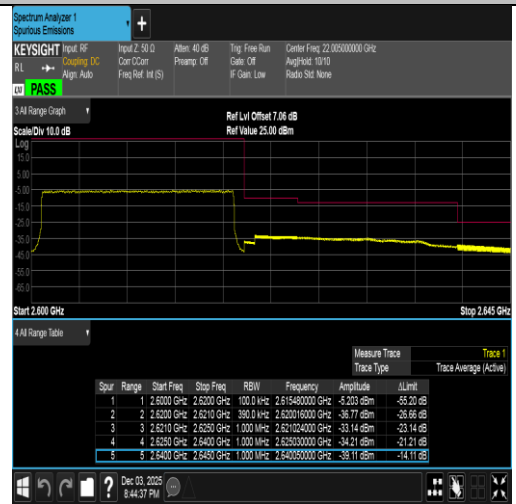

Band38-20MHz-16QAM-38150-100RB#0-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	0.009~0.15	-72.03	PASS
Band38	5MHz	QPSK	37775	1RB#0	0.15~30	-63.64	PASS
Band38	5MHz	QPSK	37775	1RB#0	30~1000	-63.51	PASS
Band38	5MHz	QPSK	37775	1RB#0	1000~3000	-50.90	PASS
Band38	5MHz	QPSK	37775	1RB#0	3000~18000	-46.81	PASS
Band38	5MHz	QPSK	37775	1RB#0	18000~27000	-43.51	PASS
Band38	5MHz	QPSK	37775	1RB#24	0.009~0.15	-72.39	PASS
Band38	5MHz	QPSK	37775	1RB#24	0.15~30	-64.90	PASS
Band38	5MHz	QPSK	37775	1RB#24	30~1000	-63.42	PASS
Band38	5MHz	QPSK	37775	1RB#24	1000~3000	-50.96	PASS
Band38	5MHz	QPSK	37775	1RB#24	3000~18000	-46.80	PASS
Band38	5MHz	QPSK	37775	1RB#24	18000~27000	-43.55	PASS
Band38	5MHz	QPSK	37775	25RB#0	0.009~0.15	-79.17	PASS
Band38	5MHz	QPSK	37775	25RB#0	0.15~30	-65.42	PASS
Band38	5MHz	QPSK	37775	25RB#0	30~1000	-63.54	PASS
Band38	5MHz	QPSK	37775	25RB#0	1000~3000	-46.31	PASS
Band38	5MHz	QPSK	37775	25RB#0	3000~18000	-46.76	PASS
Band38	5MHz	QPSK	37775	25RB#0	18000~27000	-43.66	PASS
Band38	5MHz	16QAM	37775	1RB#0	0.009~0.15	-71.58	PASS
Band38	5MHz	16QAM	37775	1RB#0	0.15~30	-65.86	PASS
Band38	5MHz	16QAM	37775	1RB#0	30~1000	-63.40	PASS
Band38	5MHz	16QAM	37775	1RB#0	1000~3000	-50.59	PASS
Band38	5MHz	16QAM	37775	1RB#0	3000~18000	-46.88	PASS
Band38	5MHz	16QAM	37775	1RB#0	18000~27000	-43.59	PASS
Band38	5MHz	16QAM	37775	1RB#24	0.009~0.15	-73.03	PASS
Band38	5MHz	16QAM	37775	1RB#24	0.15~30	-65.15	PASS
Band38	5MHz	16QAM	37775	1RB#24	30~1000	-63.40	PASS
Band38	5MHz	16QAM	37775	1RB#24	1000~3000	-50.94	PASS
Band38	5MHz	16QAM	37775	1RB#24	3000~18000	-46.93	PASS
Band38	5MHz	16QAM	37775	1RB#24	18000~27000	-43.57	PASS
Band38	5MHz	16QAM	37775	25RB#0	0.009~0.15	-78.68	PASS
Band38	5MHz	16QAM	37775	25RB#0	0.15~30	-65.44	PASS
Band38	5MHz	16QAM	37775	25RB#0	30~1000	-63.28	PASS
Band38	5MHz	16QAM	37775	25RB#0	1000~3000	-51.01	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	5MHz	16QAM	37775	25RB#0	3000~18000	-46.86	PASS
Band38	5MHz	16QAM	37775	25RB#0	18000~27000	-43.64	PASS
Band38	5MHz	QPSK	38000	1RB#0	0.009~0.15	-72.05	PASS
Band38	5MHz	QPSK	38000	1RB#0	0.15~30	-65.44	PASS
Band38	5MHz	QPSK	38000	1RB#0	30~1000	-61.95	PASS
Band38	5MHz	QPSK	38000	1RB#0	1000~3000	-51.00	PASS
Band38	5MHz	QPSK	38000	1RB#0	3000~18000	-46.84	PASS
Band38	5MHz	QPSK	38000	1RB#0	18000~27000	-43.61	PASS
Band38	5MHz	QPSK	38000	1RB#24	0.009~0.15	-78.13	PASS
Band38	5MHz	QPSK	38000	1RB#24	0.15~30	-65.93	PASS
Band38	5MHz	QPSK	38000	1RB#24	30~1000	-63.47	PASS
Band38	5MHz	QPSK	38000	1RB#24	1000~3000	-50.97	PASS
Band38	5MHz	QPSK	38000	1RB#24	3000~18000	-46.91	PASS
Band38	5MHz	QPSK	38000	1RB#24	18000~27000	-43.64	PASS
Band38	5MHz	QPSK	38000	25RB#0	0.009~0.15	-79.28	PASS
Band38	5MHz	QPSK	38000	25RB#0	0.15~30	-66.11	PASS
Band38	5MHz	QPSK	38000	25RB#0	30~1000	-63.58	PASS
Band38	5MHz	QPSK	38000	25RB#0	1000~3000	-50.99	PASS
Band38	5MHz	QPSK	38000	25RB#0	3000~18000	-46.91	PASS
Band38	5MHz	QPSK	38000	25RB#0	18000~27000	-43.62	PASS
Band38	5MHz	16QAM	38000	1RB#0	0.009~0.15	-71.92	PASS
Band38	5MHz	16QAM	38000	1RB#0	0.15~30	-65.33	PASS
Band38	5MHz	16QAM	38000	1RB#0	30~1000	-63.38	PASS
Band38	5MHz	16QAM	38000	1RB#0	1000~3000	-50.99	PASS
Band38	5MHz	16QAM	38000	1RB#0	3000~18000	-46.79	PASS
Band38	5MHz	16QAM	38000	1RB#0	18000~27000	-43.64	PASS
Band38	5MHz	16QAM	38000	1RB#24	0.009~0.15	-79.01	PASS
Band38	5MHz	16QAM	38000	1RB#24	0.15~30	-65.72	PASS
Band38	5MHz	16QAM	38000	1RB#24	30~1000	-63.52	PASS
Band38	5MHz	16QAM	38000	1RB#24	1000~3000	-50.97	PASS
Band38	5MHz	16QAM	38000	1RB#24	3000~18000	-46.75	PASS
Band38	5MHz	16QAM	38000	1RB#24	18000~27000	-43.42	PASS
Band38	5MHz	16QAM	38000	25RB#0	0.009~0.15	-77.59	PASS
Band38	5MHz	16QAM	38000	25RB#0	0.15~30	-65.77	PASS
Band38	5MHz	16QAM	38000	25RB#0	30~1000	-63.28	PASS
Band38	5MHz	16QAM	38000	25RB#0	1000~3000	-50.98	PASS
Band38	5MHz	16QAM	38000	25RB#0	3000~18000	-46.85	PASS
Band38	5MHz	16QAM	38000	25RB#0	18000~27000	-43.51	PASS
Band38	5MHz	QPSK	38225	1RB#0	0.009~0.15	-71.62	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	5MHz	QPSK	38225	1RB#0	0.15~30	-65.50	PASS
Band38	5MHz	QPSK	38225	1RB#0	30~1000	-63.29	PASS
Band38	5MHz	QPSK	38225	1RB#0	1000~3000	-50.99	PASS
Band38	5MHz	QPSK	38225	1RB#0	3000~18000	-46.92	PASS
Band38	5MHz	QPSK	38225	1RB#0	18000~27000	-43.64	PASS
Band38	5MHz	QPSK	38225	1RB#24	0.009~0.15	-72.82	PASS
Band38	5MHz	QPSK	38225	1RB#24	0.15~30	-65.15	PASS
Band38	5MHz	QPSK	38225	1RB#24	30~1000	-63.46	PASS
Band38	5MHz	QPSK	38225	1RB#24	1000~3000	-50.84	PASS
Band38	5MHz	QPSK	38225	1RB#24	3000~18000	-46.89	PASS
Band38	5MHz	QPSK	38225	1RB#24	18000~27000	-43.59	PASS
Band38	5MHz	QPSK	38225	25RB#0	0.009~0.15	-78.95	PASS
Band38	5MHz	QPSK	38225	25RB#0	0.15~30	-65.52	PASS
Band38	5MHz	QPSK	38225	25RB#0	30~1000	-63.65	PASS
Band38	5MHz	QPSK	38225	25RB#0	1000~3000	-46.82	PASS
Band38	5MHz	QPSK	38225	25RB#0	3000~18000	-46.94	PASS
Band38	5MHz	QPSK	38225	25RB#0	18000~27000	-43.71	PASS
Band38	5MHz	16QAM	38225	1RB#0	0.009~0.15	-73.12	PASS
Band38	5MHz	16QAM	38225	1RB#0	0.15~30	-65.57	PASS
Band38	5MHz	16QAM	38225	1RB#0	30~1000	-63.43	PASS
Band38	5MHz	16QAM	38225	1RB#0	1000~3000	-50.97	PASS
Band38	5MHz	16QAM	38225	1RB#0	3000~18000	-46.98	PASS
Band38	5MHz	16QAM	38225	1RB#0	18000~27000	-43.45	PASS
Band38	5MHz	16QAM	38225	1RB#24	0.009~0.15	-70.75	PASS
Band38	5MHz	16QAM	38225	1RB#24	0.15~30	-65.70	PASS
Band38	5MHz	16QAM	38225	1RB#24	30~1000	-63.28	PASS
Band38	5MHz	16QAM	38225	1RB#24	1000~3000	-51.01	PASS
Band38	5MHz	16QAM	38225	1RB#24	3000~18000	-46.96	PASS
Band38	5MHz	16QAM	38225	1RB#24	18000~27000	-43.64	PASS
Band38	5MHz	16QAM	38225	25RB#0	0.009~0.15	-77.93	PASS
Band38	5MHz	16QAM	38225	25RB#0	0.15~30	-66.13	PASS
Band38	5MHz	16QAM	38225	25RB#0	30~1000	-63.64	PASS
Band38	5MHz	16QAM	38225	25RB#0	1000~3000	-46.25	PASS
Band38	5MHz	16QAM	38225	25RB#0	3000~18000	-46.92	PASS
Band38	5MHz	16QAM	38225	25RB#0	18000~27000	-43.65	PASS
Band38	10MHz	QPSK	37800	1RB#0	0.009~0.15	-72.72	PASS
Band38	10MHz	QPSK	37800	1RB#0	0.15~30	-64.58	PASS
Band38	10MHz	QPSK	37800	1RB#0	30~1000	-63.53	PASS
Band38	10MHz	QPSK	37800	1RB#0	1000~3000	-38.18	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	10MHz	QPSK	37800	1RB#0	3000~18000	-46.89	PASS
Band38	10MHz	QPSK	37800	1RB#0	18000~27000	-43.56	PASS
Band38	10MHz	QPSK	37800	1RB#49	0.009~0.15	-72.29	PASS
Band38	10MHz	QPSK	37800	1RB#49	0.15~30	-65.92	PASS
Band38	10MHz	QPSK	37800	1RB#49	30~1000	-63.42	PASS
Band38	10MHz	QPSK	37800	1RB#49	1000~3000	-50.92	PASS
Band38	10MHz	QPSK	37800	1RB#49	3000~18000	-46.91	PASS
Band38	10MHz	QPSK	37800	1RB#49	18000~27000	-43.38	PASS
Band38	10MHz	QPSK	37800	50RB#0	0.009~0.15	-79.32	PASS
Band38	10MHz	QPSK	37800	50RB#0	0.15~30	-65.31	PASS
Band38	10MHz	QPSK	37800	50RB#0	30~1000	-63.60	PASS
Band38	10MHz	QPSK	37800	50RB#0	1000~3000	-46.05	PASS
Band38	10MHz	QPSK	37800	50RB#0	3000~18000	-46.63	PASS
Band38	10MHz	QPSK	37800	50RB#0	18000~27000	-43.52	PASS
Band38	10MHz	16QAM	37800	1RB#0	0.009~0.15	-72.52	PASS
Band38	10MHz	16QAM	37800	1RB#0	0.15~30	-65.69	PASS
Band38	10MHz	16QAM	37800	1RB#0	30~1000	-63.40	PASS
Band38	10MHz	16QAM	37800	1RB#0	1000~3000	-41.49	PASS
Band38	10MHz	16QAM	37800	1RB#0	3000~18000	-46.93	PASS
Band38	10MHz	16QAM	37800	1RB#0	18000~27000	-43.58	PASS
Band38	10MHz	16QAM	37800	1RB#49	0.009~0.15	-72.85	PASS
Band38	10MHz	16QAM	37800	1RB#49	0.15~30	-66.05	PASS
Band38	10MHz	16QAM	37800	1RB#49	30~1000	-63.46	PASS
Band38	10MHz	16QAM	37800	1RB#49	1000~3000	-50.93	PASS
Band38	10MHz	16QAM	37800	1RB#49	3000~18000	-46.85	PASS
Band38	10MHz	16QAM	37800	1RB#49	18000~27000	-43.47	PASS
Band38	10MHz	16QAM	37800	50RB#0	0.009~0.15	-79.41	PASS
Band38	10MHz	16QAM	37800	50RB#0	0.15~30	-65.99	PASS
Band38	10MHz	16QAM	37800	50RB#0	30~1000	-63.34	PASS
Band38	10MHz	16QAM	37800	50RB#0	1000~3000	-46.65	PASS
Band38	10MHz	16QAM	37800	50RB#0	3000~18000	-46.92	PASS
Band38	10MHz	16QAM	37800	50RB#0	18000~27000	-43.45	PASS
Band38	10MHz	QPSK	38000	1RB#0	0.009~0.15	-72.55	PASS
Band38	10MHz	QPSK	38000	1RB#0	0.15~30	-65.56	PASS
Band38	10MHz	QPSK	38000	1RB#0	30~1000	-63.47	PASS
Band38	10MHz	QPSK	38000	1RB#0	1000~3000	-50.81	PASS
Band38	10MHz	QPSK	38000	1RB#0	3000~18000	-46.96	PASS
Band38	10MHz	QPSK	38000	1RB#0	18000~27000	-43.60	PASS
Band38	10MHz	QPSK	38000	1RB#49	0.009~0.15	-72.09	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	10MHz	QPSK	38000	1RB#49	0.15~30	-65.54	PASS
Band38	10MHz	QPSK	38000	1RB#49	30~1000	-63.52	PASS
Band38	10MHz	QPSK	38000	1RB#49	1000~3000	-50.90	PASS
Band38	10MHz	QPSK	38000	1RB#49	3000~18000	-46.82	PASS
Band38	10MHz	QPSK	38000	1RB#49	18000~27000	-43.51	PASS
Band38	10MHz	QPSK	38000	50RB#0	0.009~0.15	-78.37	PASS
Band38	10MHz	QPSK	38000	50RB#0	0.15~30	-65.42	PASS
Band38	10MHz	QPSK	38000	50RB#0	30~1000	-63.20	PASS
Band38	10MHz	QPSK	38000	50RB#0	1000~3000	-50.89	PASS
Band38	10MHz	QPSK	38000	50RB#0	3000~18000	-46.86	PASS
Band38	10MHz	QPSK	38000	50RB#0	18000~27000	-43.41	PASS
Band38	10MHz	16QAM	38000	1RB#0	0.009~0.15	-72.54	PASS
Band38	10MHz	16QAM	38000	1RB#0	0.15~30	-65.12	PASS
Band38	10MHz	16QAM	38000	1RB#0	30~1000	-63.44	PASS
Band38	10MHz	16QAM	38000	1RB#0	1000~3000	-50.89	PASS
Band38	10MHz	16QAM	38000	1RB#0	3000~18000	-46.75	PASS
Band38	10MHz	16QAM	38000	1RB#0	18000~27000	-43.42	PASS
Band38	10MHz	16QAM	38000	1RB#49	0.009~0.15	-71.50	PASS
Band38	10MHz	16QAM	38000	1RB#49	0.15~30	-65.17	PASS
Band38	10MHz	16QAM	38000	1RB#49	30~1000	-63.40	PASS
Band38	10MHz	16QAM	38000	1RB#49	1000~3000	-50.91	PASS
Band38	10MHz	16QAM	38000	1RB#49	3000~18000	-46.80	PASS
Band38	10MHz	16QAM	38000	1RB#49	18000~27000	-43.45	PASS
Band38	10MHz	16QAM	38000	50RB#0	0.009~0.15	-79.19	PASS
Band38	10MHz	16QAM	38000	50RB#0	0.15~30	-65.39	PASS
Band38	10MHz	16QAM	38000	50RB#0	30~1000	-63.23	PASS
Band38	10MHz	16QAM	38000	50RB#0	1000~3000	-50.89	PASS
Band38	10MHz	16QAM	38000	50RB#0	3000~18000	-46.74	PASS
Band38	10MHz	16QAM	38000	50RB#0	18000~27000	-43.49	PASS
Band38	10MHz	QPSK	38200	1RB#0	0.009~0.15	-70.72	PASS
Band38	10MHz	QPSK	38200	1RB#0	0.15~30	-65.34	PASS
Band38	10MHz	QPSK	38200	1RB#0	30~1000	-62.53	PASS
Band38	10MHz	QPSK	38200	1RB#0	1000~3000	-50.92	PASS
Band38	10MHz	QPSK	38200	1RB#0	3000~18000	-46.85	PASS
Band38	10MHz	QPSK	38200	1RB#0	18000~27000	-43.44	PASS
Band38	10MHz	QPSK	38200	1RB#49	0.009~0.15	-71.97	PASS
Band38	10MHz	QPSK	38200	1RB#49	0.15~30	-65.65	PASS
Band38	10MHz	QPSK	38200	1RB#49	30~1000	-63.21	PASS
Band38	10MHz	QPSK	38200	1RB#49	1000~3000	-44.02	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	10MHz	QPSK	38200	1RB#49	3000~18000	-46.84	PASS
Band38	10MHz	QPSK	38200	1RB#49	18000~27000	-43.46	PASS
Band38	10MHz	QPSK	38200	50RB#0	0.009~0.15	-78.75	PASS
Band38	10MHz	QPSK	38200	50RB#0	0.15~30	-65.26	PASS
Band38	10MHz	QPSK	38200	50RB#0	30~1000	-63.46	PASS
Band38	10MHz	QPSK	38200	50RB#0	1000~3000	-41.06	PASS
Band38	10MHz	QPSK	38200	50RB#0	3000~18000	-46.75	PASS
Band38	10MHz	QPSK	38200	50RB#0	18000~27000	-43.48	PASS
Band38	10MHz	16QAM	38200	1RB#0	0.009~0.15	-72.88	PASS
Band38	10MHz	16QAM	38200	1RB#0	0.15~30	-66.08	PASS
Band38	10MHz	16QAM	38200	1RB#0	30~1000	-63.33	PASS
Band38	10MHz	16QAM	38200	1RB#0	1000~3000	-50.93	PASS
Band38	10MHz	16QAM	38200	1RB#0	3000~18000	-46.80	PASS
Band38	10MHz	16QAM	38200	1RB#0	18000~27000	-43.45	PASS
Band38	10MHz	16QAM	38200	1RB#49	0.009~0.15	-72.91	PASS
Band38	10MHz	16QAM	38200	1RB#49	0.15~30	-65.26	PASS
Band38	10MHz	16QAM	38200	1RB#49	30~1000	-63.56	PASS
Band38	10MHz	16QAM	38200	1RB#49	1000~3000	-41.84	PASS
Band38	10MHz	16QAM	38200	1RB#49	3000~18000	-46.67	PASS
Band38	10MHz	16QAM	38200	1RB#49	18000~27000	-43.39	PASS
Band38	10MHz	16QAM	38200	50RB#0	0.009~0.15	-78.48	PASS
Band38	10MHz	16QAM	38200	50RB#0	0.15~30	-64.91	PASS
Band38	10MHz	16QAM	38200	50RB#0	30~1000	-63.41	PASS
Band38	10MHz	16QAM	38200	50RB#0	1000~3000	-44.38	PASS
Band38	10MHz	16QAM	38200	50RB#0	3000~18000	-46.73	PASS
Band38	10MHz	16QAM	38200	50RB#0	18000~27000	-43.39	PASS
Band38	15MHz	QPSK	37825	1RB#0	0.009~0.15	-72.08	PASS
Band38	15MHz	QPSK	37825	1RB#0	0.15~30	-63.94	PASS
Band38	15MHz	QPSK	37825	1RB#0	30~1000	-63.22	PASS
Band38	15MHz	QPSK	37825	1RB#0	1000~3000	-37.75	PASS
Band38	15MHz	QPSK	37825	1RB#0	3000~18000	-46.87	PASS
Band38	15MHz	QPSK	37825	1RB#0	18000~27000	-43.41	PASS
Band38	15MHz	QPSK	37825	1RB#74	0.009~0.15	-72.60	PASS
Band38	15MHz	QPSK	37825	1RB#74	0.15~30	-64.49	PASS
Band38	15MHz	QPSK	37825	1RB#74	30~1000	-63.33	PASS
Band38	15MHz	QPSK	37825	1RB#74	1000~3000	-50.94	PASS
Band38	15MHz	QPSK	37825	1RB#74	3000~18000	-46.83	PASS
Band38	15MHz	QPSK	37825	1RB#74	18000~27000	-43.27	PASS
Band38	15MHz	QPSK	37825	75RB#0	0.009~0.15	-78.16	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	15MHz	QPSK	37825	75RB#0	0.15~30	-65.91	PASS
Band38	15MHz	QPSK	37825	75RB#0	30~1000	-63.29	PASS
Band38	15MHz	QPSK	37825	75RB#0	1000~3000	-43.81	PASS
Band38	15MHz	QPSK	37825	75RB#0	3000~18000	-46.81	PASS
Band38	15MHz	QPSK	37825	75RB#0	18000~27000	-43.44	PASS
Band38	15MHz	16QAM	37825	1RB#0	0.009~0.15	-73.94	PASS
Band38	15MHz	16QAM	37825	1RB#0	0.15~30	-65.64	PASS
Band38	15MHz	16QAM	37825	1RB#0	30~1000	-63.39	PASS
Band38	15MHz	16QAM	37825	1RB#0	1000~3000	-40.05	PASS
Band38	15MHz	16QAM	37825	1RB#0	3000~18000	-46.83	PASS
Band38	15MHz	16QAM	37825	1RB#0	18000~27000	-43.39	PASS
Band38	15MHz	16QAM	37825	1RB#74	0.009~0.15	-73.20	PASS
Band38	15MHz	16QAM	37825	1RB#74	0.15~30	-65.63	PASS
Band38	15MHz	16QAM	37825	1RB#74	30~1000	-63.38	PASS
Band38	15MHz	16QAM	37825	1RB#74	1000~3000	-50.89	PASS
Band38	15MHz	16QAM	37825	1RB#74	3000~18000	-46.79	PASS
Band38	15MHz	16QAM	37825	1RB#74	18000~27000	-43.56	PASS
Band38	15MHz	16QAM	37825	75RB#0	0.009~0.15	-78.26	PASS
Band38	15MHz	16QAM	37825	75RB#0	0.15~30	-65.19	PASS
Band38	15MHz	16QAM	37825	75RB#0	30~1000	-63.35	PASS
Band38	15MHz	16QAM	37825	75RB#0	1000~3000	-46.18	PASS
Band38	15MHz	16QAM	37825	75RB#0	3000~18000	-46.70	PASS
Band38	15MHz	16QAM	37825	75RB#0	18000~27000	-43.46	PASS
Band38	15MHz	QPSK	38000	1RB#0	0.009~0.15	-73.73	PASS
Band38	15MHz	QPSK	38000	1RB#0	0.15~30	-62.77	PASS
Band38	15MHz	QPSK	38000	1RB#0	30~1000	-63.22	PASS
Band38	15MHz	QPSK	38000	1RB#0	1000~3000	-50.88	PASS
Band38	15MHz	QPSK	38000	1RB#0	3000~18000	-46.74	PASS
Band38	15MHz	QPSK	38000	1RB#0	18000~27000	-43.44	PASS
Band38	15MHz	QPSK	38000	1RB#74	0.009~0.15	-71.69	PASS
Band38	15MHz	QPSK	38000	1RB#74	0.15~30	-65.65	PASS
Band38	15MHz	QPSK	38000	1RB#74	30~1000	-63.20	PASS
Band38	15MHz	QPSK	38000	1RB#74	1000~3000	-50.85	PASS
Band38	15MHz	QPSK	38000	1RB#74	3000~18000	-46.78	PASS
Band38	15MHz	QPSK	38000	1RB#74	18000~27000	-43.44	PASS
Band38	15MHz	QPSK	38000	75RB#0	0.009~0.15	-78.80	PASS
Band38	15MHz	QPSK	38000	75RB#0	0.15~30	-65.39	PASS
Band38	15MHz	QPSK	38000	75RB#0	30~1000	-63.55	PASS
Band38	15MHz	QPSK	38000	75RB#0	1000~3000	-48.57	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	15MHz	QPSK	38000	75RB#0	3000~18000	-46.71	PASS
Band38	15MHz	QPSK	38000	75RB#0	18000~27000	-43.37	PASS
Band38	15MHz	16QAM	38000	1RB#0	0.009~0.15	-73.38	PASS
Band38	15MHz	16QAM	38000	1RB#0	0.15~30	-65.91	PASS
Band38	15MHz	16QAM	38000	1RB#0	30~1000	-63.22	PASS
Band38	15MHz	16QAM	38000	1RB#0	1000~3000	-50.81	PASS
Band38	15MHz	16QAM	38000	1RB#0	3000~18000	-46.80	PASS
Band38	15MHz	16QAM	38000	1RB#0	18000~27000	-43.46	PASS
Band38	15MHz	16QAM	38000	1RB#74	0.009~0.15	-71.67	PASS
Band38	15MHz	16QAM	38000	1RB#74	0.15~30	-65.72	PASS
Band38	15MHz	16QAM	38000	1RB#74	30~1000	-63.43	PASS
Band38	15MHz	16QAM	38000	1RB#74	1000~3000	-50.94	PASS
Band38	15MHz	16QAM	38000	1RB#74	3000~18000	-46.79	PASS
Band38	15MHz	16QAM	38000	1RB#74	18000~27000	-43.35	PASS
Band38	15MHz	16QAM	38000	75RB#0	0.009~0.15	-78.09	PASS
Band38	15MHz	16QAM	38000	75RB#0	0.15~30	-65.46	PASS
Band38	15MHz	16QAM	38000	75RB#0	30~1000	-63.53	PASS
Band38	15MHz	16QAM	38000	75RB#0	1000~3000	-50.16	PASS
Band38	15MHz	16QAM	38000	75RB#0	3000~18000	-46.88	PASS
Band38	15MHz	16QAM	38000	75RB#0	18000~27000	-43.49	PASS
Band38	15MHz	QPSK	38175	1RB#0	0.009~0.15	-72.11	PASS
Band38	15MHz	QPSK	38175	1RB#0	0.15~30	-65.88	PASS
Band38	15MHz	QPSK	38175	1RB#0	30~1000	-63.13	PASS
Band38	15MHz	QPSK	38175	1RB#0	1000~3000	-50.85	PASS
Band38	15MHz	QPSK	38175	1RB#0	3000~18000	-46.91	PASS
Band38	15MHz	QPSK	38175	1RB#0	18000~27000	-43.40	PASS
Band38	15MHz	QPSK	38175	1RB#74	0.009~0.15	-72.48	PASS
Band38	15MHz	QPSK	38175	1RB#74	0.15~30	-65.34	PASS
Band38	15MHz	QPSK	38175	1RB#74	30~1000	-63.22	PASS
Band38	15MHz	QPSK	38175	1RB#74	1000~3000	-44.90	PASS
Band38	15MHz	QPSK	38175	1RB#74	3000~18000	-46.69	PASS
Band38	15MHz	QPSK	38175	1RB#74	18000~27000	-43.40	PASS
Band38	15MHz	QPSK	38175	75RB#0	0.009~0.15	-78.46	PASS
Band38	15MHz	QPSK	38175	75RB#0	0.15~30	-65.86	PASS
Band38	15MHz	QPSK	38175	75RB#0	30~1000	-63.29	PASS
Band38	15MHz	QPSK	38175	75RB#0	1000~3000	-41.39	PASS
Band38	15MHz	QPSK	38175	75RB#0	3000~18000	-46.82	PASS
Band38	15MHz	QPSK	38175	75RB#0	18000~27000	-43.43	PASS
Band38	15MHz	16QAM	38175	1RB#0	0.009~0.15	-72.27	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	15MHz	16QAM	38175	1RB#0	0.15~30	-65.92	PASS
Band38	15MHz	16QAM	38175	1RB#0	30~1000	-63.50	PASS
Band38	15MHz	16QAM	38175	1RB#0	1000~3000	-50.93	PASS
Band38	15MHz	16QAM	38175	1RB#0	3000~18000	-46.83	PASS
Band38	15MHz	16QAM	38175	1RB#0	18000~27000	-43.49	PASS
Band38	15MHz	16QAM	38175	1RB#74	0.009~0.15	-71.99	PASS
Band38	15MHz	16QAM	38175	1RB#74	0.15~30	-64.93	PASS
Band38	15MHz	16QAM	38175	1RB#74	30~1000	-63.23	PASS
Band38	15MHz	16QAM	38175	1RB#74	1000~3000	-46.15	PASS
Band38	15MHz	16QAM	38175	1RB#74	3000~18000	-46.75	PASS
Band38	15MHz	16QAM	38175	1RB#74	18000~27000	-43.51	PASS
Band38	15MHz	16QAM	38175	75RB#0	0.009~0.15	-79.51	PASS
Band38	15MHz	16QAM	38175	75RB#0	0.15~30	-65.95	PASS
Band38	15MHz	16QAM	38175	75RB#0	30~1000	-63.31	PASS
Band38	15MHz	16QAM	38175	75RB#0	1000~3000	-44.42	PASS
Band38	15MHz	16QAM	38175	75RB#0	3000~18000	-46.72	PASS
Band38	15MHz	16QAM	38175	75RB#0	18000~27000	-43.47	PASS
Band38	20MHz	QPSK	37850	1RB#0	0.009~0.15	-71.63	PASS
Band38	20MHz	QPSK	37850	1RB#0	0.15~30	-64.94	PASS
Band38	20MHz	QPSK	37850	1RB#0	30~1000	-63.19	PASS
Band38	20MHz	QPSK	37850	1RB#0	1000~3000	-39.34	PASS
Band38	20MHz	QPSK	37850	1RB#0	3000~18000	-46.66	PASS
Band38	20MHz	QPSK	37850	1RB#0	18000~27000	-43.37	PASS
Band38	20MHz	QPSK	37850	1RB#99	0.009~0.15	-72.30	PASS
Band38	20MHz	QPSK	37850	1RB#99	0.15~30	-65.90	PASS
Band38	20MHz	QPSK	37850	1RB#99	30~1000	-63.28	PASS
Band38	20MHz	QPSK	37850	1RB#99	1000~3000	-50.95	PASS
Band38	20MHz	QPSK	37850	1RB#99	3000~18000	-46.80	PASS
Band38	20MHz	QPSK	37850	1RB#99	18000~27000	-43.40	PASS
Band38	20MHz	QPSK	37850	100RB#0	0.009~0.15	-78.95	PASS
Band38	20MHz	QPSK	37850	100RB#0	0.15~30	-65.15	PASS
Band38	20MHz	QPSK	37850	100RB#0	30~1000	-63.45	PASS
Band38	20MHz	QPSK	37850	100RB#0	1000~3000	-47.17	PASS
Band38	20MHz	QPSK	37850	100RB#0	3000~18000	-46.74	PASS
Band38	20MHz	QPSK	37850	100RB#0	18000~27000	-43.43	PASS
Band38	20MHz	16QAM	37850	1RB#0	0.009~0.15	-72.70	PASS
Band38	20MHz	16QAM	37850	1RB#0	0.15~30	-65.41	PASS
Band38	20MHz	16QAM	37850	1RB#0	30~1000	-63.52	PASS
Band38	20MHz	16QAM	37850	1RB#0	1000~3000	-40.09	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	20MHz	16QAM	37850	1RB#0	3000~18000	-46.70	PASS
Band38	20MHz	16QAM	37850	1RB#0	18000~27000	-43.52	PASS
Band38	20MHz	16QAM	37850	1RB#99	0.009~0.15	-72.29	PASS
Band38	20MHz	16QAM	37850	1RB#99	0.15~30	-66.21	PASS
Band38	20MHz	16QAM	37850	1RB#99	30~1000	-63.41	PASS
Band38	20MHz	16QAM	37850	1RB#99	1000~3000	-50.86	PASS
Band38	20MHz	16QAM	37850	1RB#99	3000~18000	-46.79	PASS
Band38	20MHz	16QAM	37850	1RB#99	18000~27000	-43.45	PASS
Band38	20MHz	16QAM	37850	100RB#0	0.009~0.15	-78.80	PASS
Band38	20MHz	16QAM	37850	100RB#0	0.15~30	-65.34	PASS
Band38	20MHz	16QAM	37850	100RB#0	30~1000	-63.31	PASS
Band38	20MHz	16QAM	37850	100RB#0	1000~3000	-47.28	PASS
Band38	20MHz	16QAM	37850	100RB#0	3000~18000	-46.82	PASS
Band38	20MHz	16QAM	37850	100RB#0	18000~27000	-43.20	PASS
Band38	20MHz	QPSK	38000	1RB#0	0.009~0.15	-72.18	PASS
Band38	20MHz	QPSK	38000	1RB#0	0.15~30	-62.51	PASS
Band38	20MHz	QPSK	38000	1RB#0	30~1000	-63.34	PASS
Band38	20MHz	QPSK	38000	1RB#0	1000~3000	-50.71	PASS
Band38	20MHz	QPSK	38000	1RB#0	3000~18000	-46.78	PASS
Band38	20MHz	QPSK	38000	1RB#0	18000~27000	-43.38	PASS
Band38	20MHz	QPSK	38000	1RB#99	0.009~0.15	-71.30	PASS
Band38	20MHz	QPSK	38000	1RB#99	0.15~30	-65.62	PASS
Band38	20MHz	QPSK	38000	1RB#99	30~1000	-62.76	PASS
Band38	20MHz	QPSK	38000	1RB#99	1000~3000	-50.85	PASS
Band38	20MHz	QPSK	38000	1RB#99	3000~18000	-46.81	PASS
Band38	20MHz	QPSK	38000	1RB#99	18000~27000	-43.36	PASS
Band38	20MHz	QPSK	38000	100RB#0	0.009~0.15	-79.63	PASS
Band38	20MHz	QPSK	38000	100RB#0	0.15~30	-65.71	PASS
Band38	20MHz	QPSK	38000	100RB#0	30~1000	-63.32	PASS
Band38	20MHz	QPSK	38000	100RB#0	1000~3000	-49.15	PASS
Band38	20MHz	QPSK	38000	100RB#0	3000~18000	-46.78	PASS
Band38	20MHz	QPSK	38000	100RB#0	18000~27000	-43.38	PASS
Band38	20MHz	16QAM	38000	1RB#0	0.009~0.15	-72.04	PASS
Band38	20MHz	16QAM	38000	1RB#0	0.15~30	-65.79	PASS
Band38	20MHz	16QAM	38000	1RB#0	30~1000	-63.42	PASS
Band38	20MHz	16QAM	38000	1RB#0	1000~3000	-50.77	PASS
Band38	20MHz	16QAM	38000	1RB#0	3000~18000	-46.79	PASS
Band38	20MHz	16QAM	38000	1RB#0	18000~27000	-43.34	PASS
Band38	20MHz	16QAM	38000	1RB#99	0.009~0.15	-72.24	PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	20MHz	16QAM	38000	1RB#99	0.15~30	-65.68	PASS
Band38	20MHz	16QAM	38000	1RB#99	30~1000	-63.41	PASS
Band38	20MHz	16QAM	38000	1RB#99	1000~3000	-50.94	PASS
Band38	20MHz	16QAM	38000	1RB#99	3000~18000	-46.76	PASS
Band38	20MHz	16QAM	38000	1RB#99	18000~27000	-43.36	PASS
Band38	20MHz	16QAM	38000	100RB#0	0.009~0.15	-78.20	PASS
Band38	20MHz	16QAM	38000	100RB#0	0.15~30	-65.48	PASS
Band38	20MHz	16QAM	38000	100RB#0	30~1000	-63.31	PASS
Band38	20MHz	16QAM	38000	100RB#0	1000~3000	-49.61	PASS
Band38	20MHz	16QAM	38000	100RB#0	3000~18000	-46.76	PASS
Band38	20MHz	16QAM	38000	100RB#0	18000~27000	-43.32	PASS
Band38	20MHz	QPSK	38150	1RB#0	0.009~0.15	-72.64	PASS
Band38	20MHz	QPSK	38150	1RB#0	0.15~30	-65.70	PASS
Band38	20MHz	QPSK	38150	1RB#0	30~1000	-63.14	PASS
Band38	20MHz	QPSK	38150	1RB#0	1000~3000	-50.65	PASS
Band38	20MHz	QPSK	38150	1RB#0	3000~18000	-46.67	PASS
Band38	20MHz	QPSK	38150	1RB#0	18000~27000	-43.41	PASS
Band38	20MHz	QPSK	38150	1RB#99	0.009~0.15	-72.21	PASS
Band38	20MHz	QPSK	38150	1RB#99	0.15~30	-66.08	PASS
Band38	20MHz	QPSK	38150	1RB#99	30~1000	-63.07	PASS
Band38	20MHz	QPSK	38150	1RB#99	1000~3000	-47.10	PASS
Band38	20MHz	QPSK	38150	1RB#99	3000~18000	-46.65	PASS
Band38	20MHz	QPSK	38150	1RB#99	18000~27000	-43.43	PASS
Band38	20MHz	QPSK	38150	100RB#0	0.009~0.15	-78.98	PASS
Band38	20MHz	QPSK	38150	100RB#0	0.15~30	-65.62	PASS
Band38	20MHz	QPSK	38150	100RB#0	30~1000	-63.32	PASS
Band38	20MHz	QPSK	38150	100RB#0	1000~3000	-41.38	PASS
Band38	20MHz	QPSK	38150	100RB#0	3000~18000	-46.77	PASS
Band38	20MHz	QPSK	38150	100RB#0	18000~27000	-43.38	PASS
Band38	20MHz	16QAM	38150	1RB#0	0.009~0.15	-71.57	PASS
Band38	20MHz	16QAM	38150	1RB#0	0.15~30	-65.09	PASS
Band38	20MHz	16QAM	38150	1RB#0	30~1000	-62.90	PASS
Band38	20MHz	16QAM	38150	1RB#0	1000~3000	-50.79	PASS
Band38	20MHz	16QAM	38150	1RB#0	3000~18000	-46.69	PASS
Band38	20MHz	16QAM	38150	1RB#0	18000~27000	-43.46	PASS
Band38	20MHz	16QAM	38150	1RB#99	0.009~0.15	-72.54	PASS
Band38	20MHz	16QAM	38150	1RB#99	0.15~30	-65.59	PASS
Band38	20MHz	16QAM	38150	1RB#99	30~1000	-62.87	PASS
Band38	20MHz	16QAM	38150	1RB#99	1000~3000	-46.77	PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	20MHz	16QAM	38150	1RB#99	3000~18000	-46.75	PASS
Band38	20MHz	16QAM	38150	1RB#99	18000~27000	-43.43	PASS
Band38	20MHz	16QAM	38150	100RB#0	0.009~0.15	-78.27	PASS
Band38	20MHz	16QAM	38150	100RB#0	0.15~30	-66.18	PASS
Band38	20MHz	16QAM	38150	100RB#0	30~1000	-63.39	PASS
Band38	20MHz	16QAM	38150	100RB#0	1000~3000	-43.51	PASS
Band38	20MHz	16QAM	38150	100RB#0	3000~18000	-46.71	PASS
Band38	20MHz	16QAM	38150	100RB#0	18000~27000	-43.39	PASS


Test Graphs

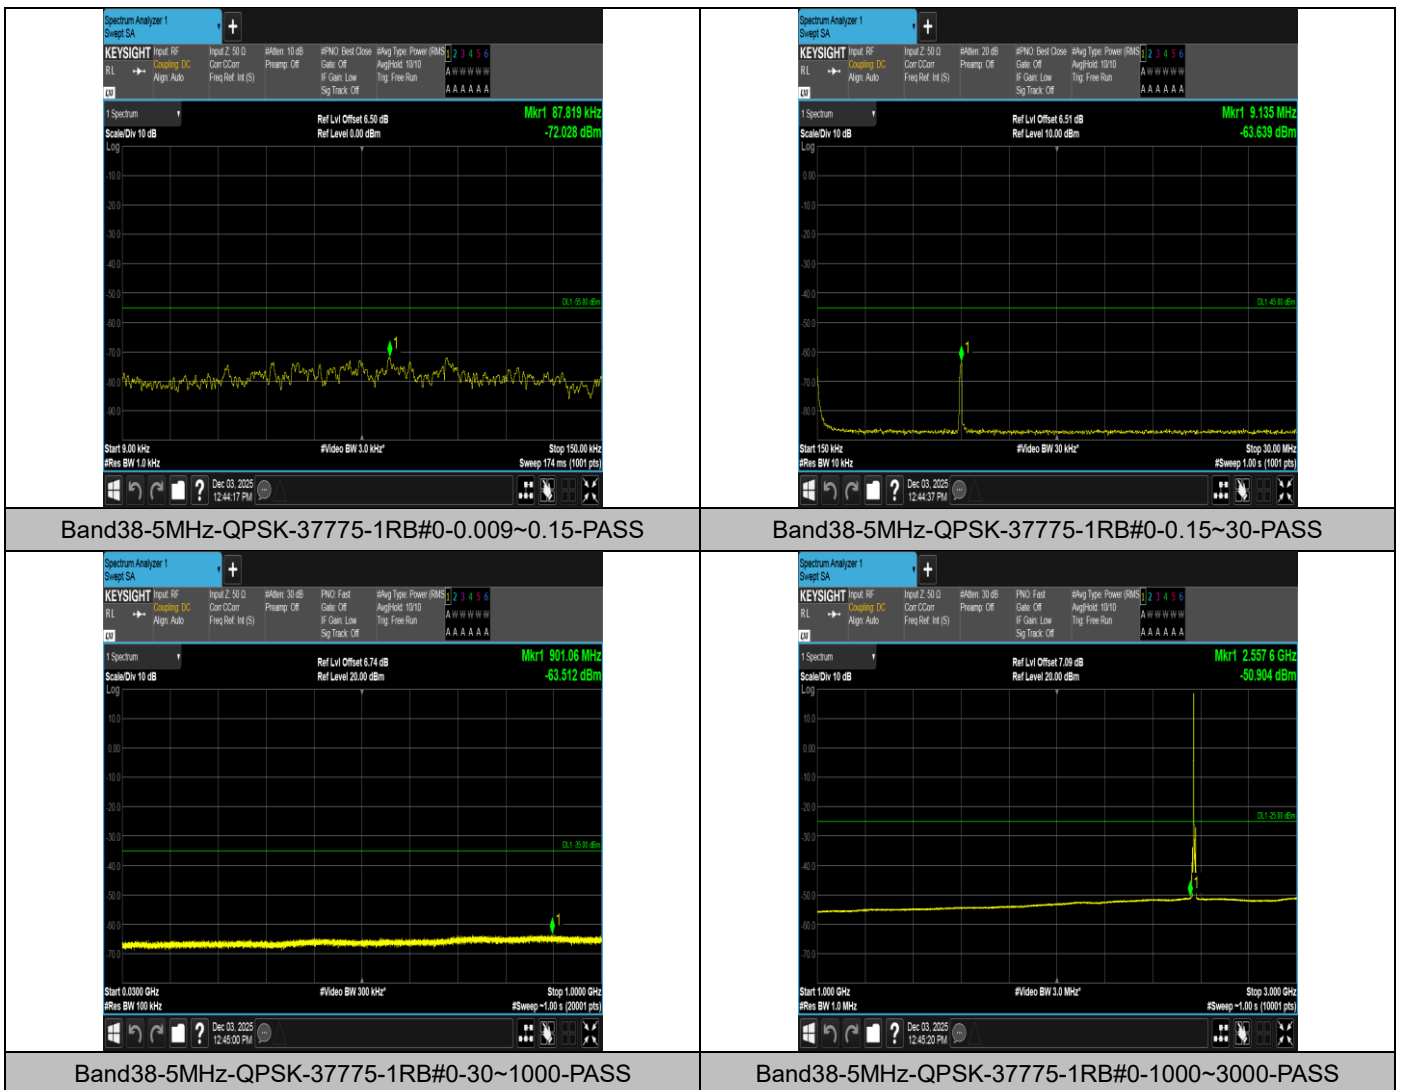


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

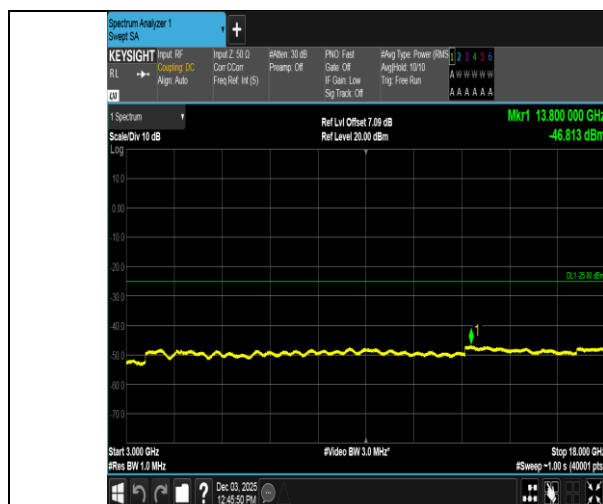


Band38-5MHz-QPSK-37775-1RB#0-3000~18000-PASS

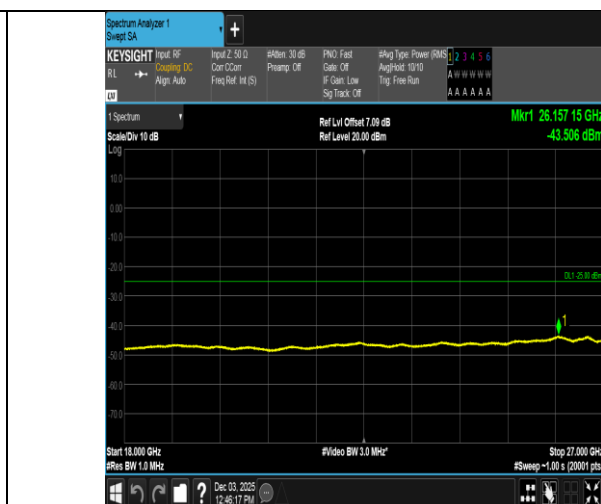


Band38-5MHz-QPSK-37775-1RB#0-18000~27000-PASS

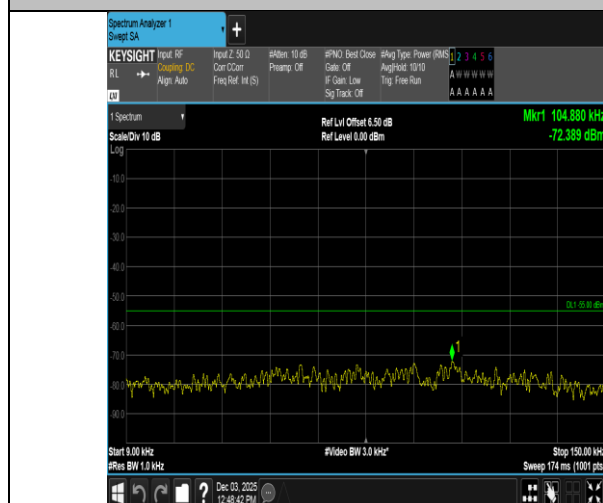


Band38-5MHz-QPSK-37775-1RB#24-0.009~0.15-PASS

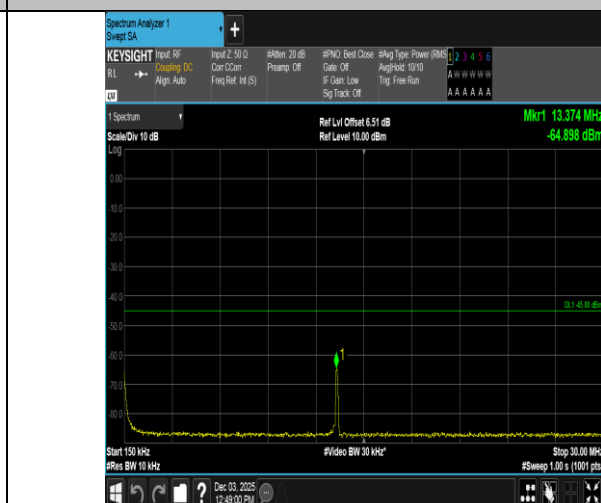

Band38-5MHz-QPSK-37775-1RB#24-0.15~30-PASS

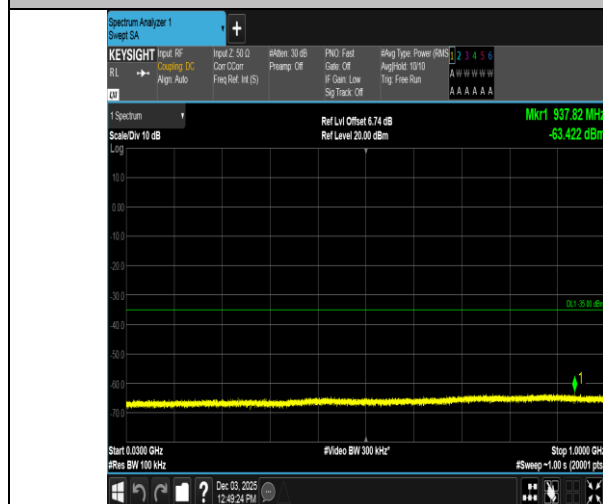


Band38-5MHz-QPSK-37775-1RB#24-30~1000-PASS

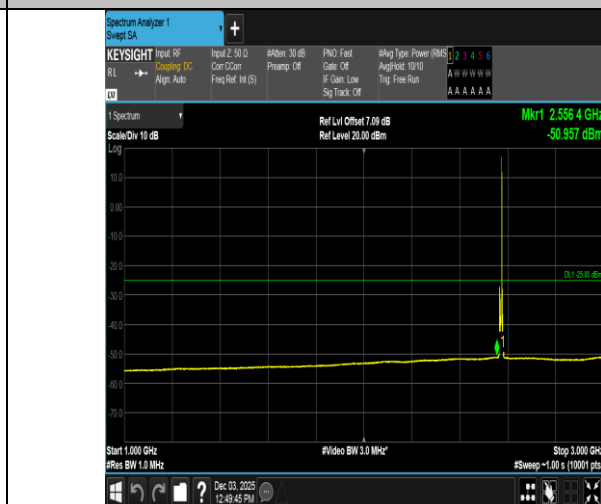


Band38-5MHz-QPSK-37775-1RB#24-1000~3000-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

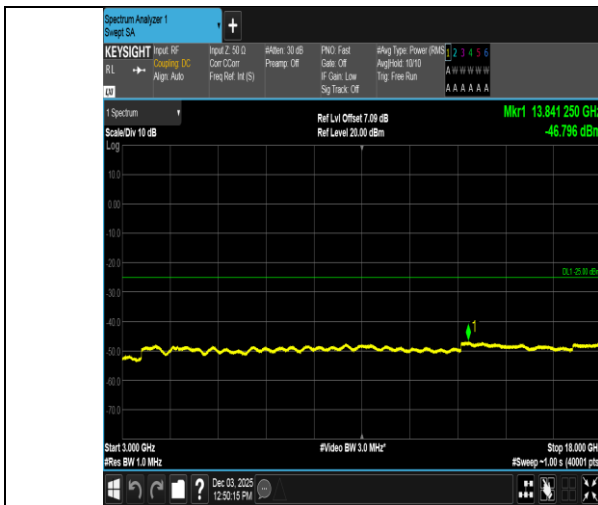


Band38-5MHz-QPSK-37775-1RB#24-3000~18000-PASS

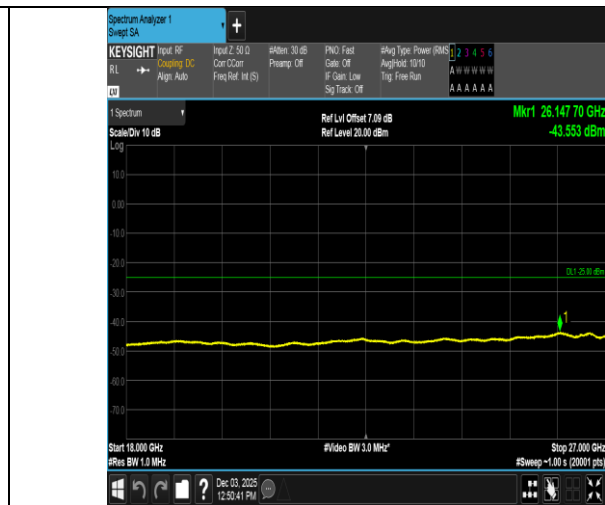

Band38-5MHz-QPSK-37775-1RB#24-18000~27000-PASS

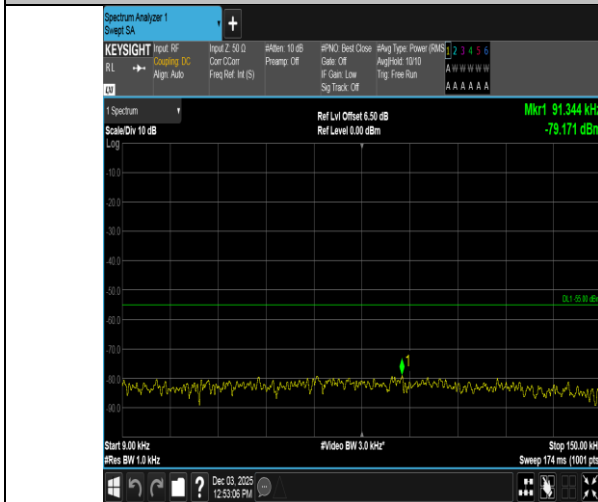

Band38-5MHz-QPSK-37775-25RB#0-0.009~0.15-PASS

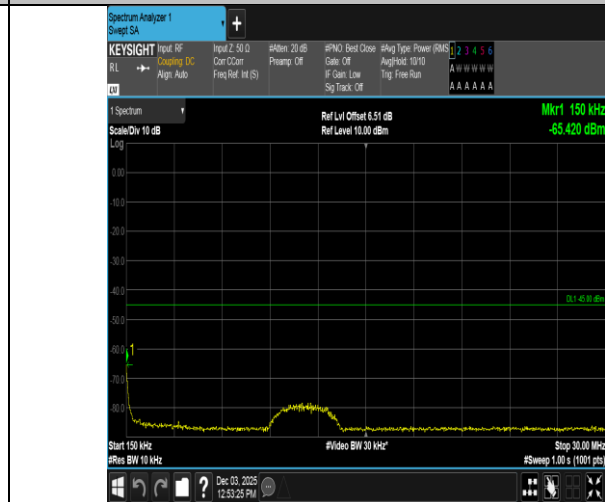

Band38-5MHz-QPSK-37775-25RB#0-0.15~30-PASS




Band38-5MHz-QPSK-37775-25RB#0-30~1000-PASS




Band38-5MHz-QPSK-37775-25RB#0-1000~3000-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

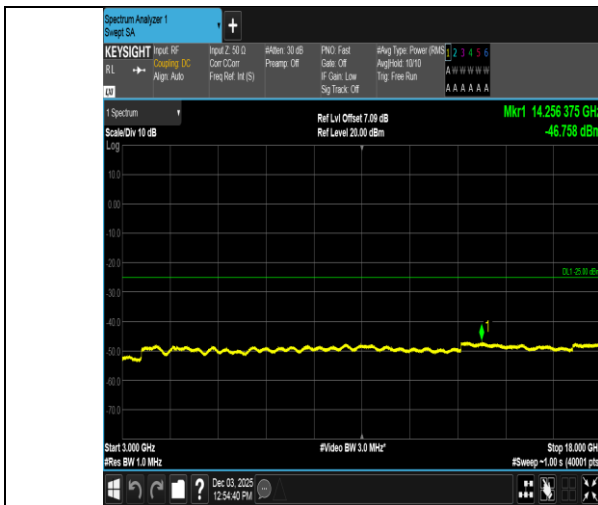


Band38-5MHz-QPSK-37775-25RB#0-3000~18000-PASS

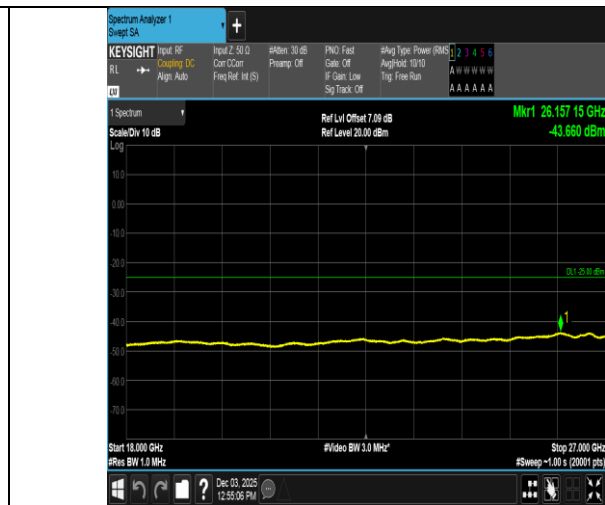


Band38-5MHz-QPSK-37775-25RB#0-18000~27000-PASS



Band38-5MHz-16QAM-37775-1RB#0-0.009~0.15-PASS

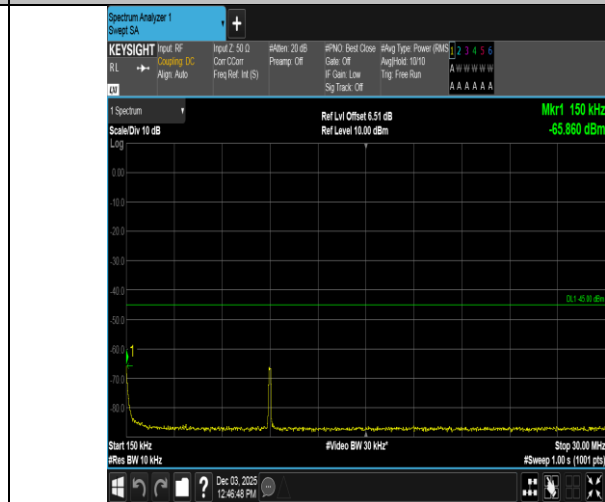

Band38-5MHz-16QAM-37775-1RB#0-0.15~30-PASS

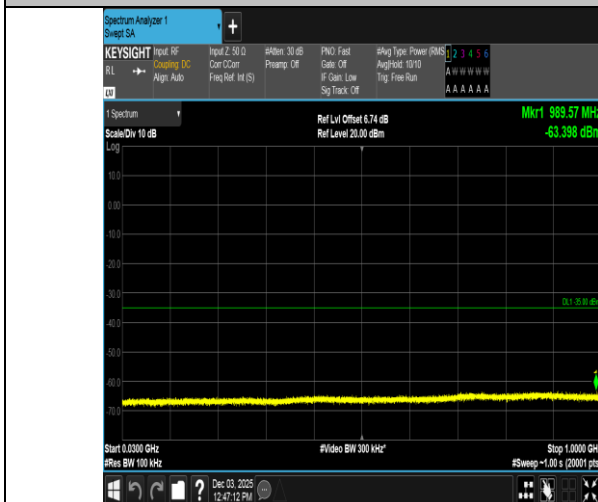


Band38-5MHz-16QAM-37775-1RB#0-30~1000-PASS




Band38-5MHz-16QAM-37775-1RB#0-1000~3000-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

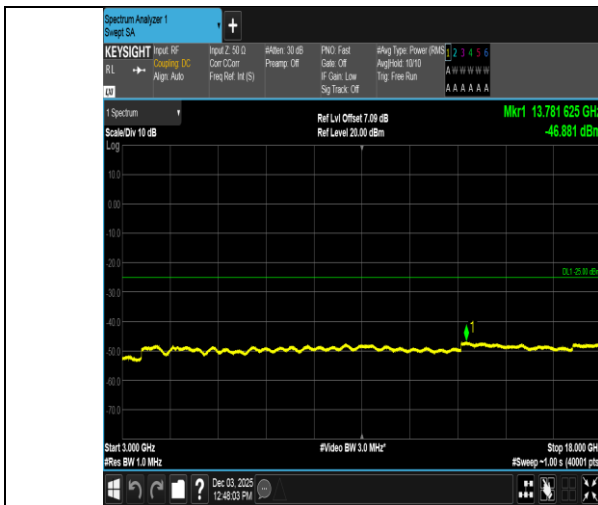


Band38-5MHz-16QAM-37775-1RB#0-3000~18000-PASS

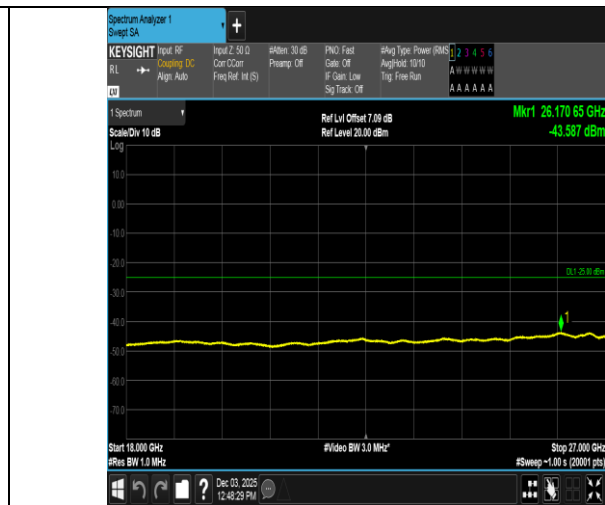

Band38-5MHz-16QAM-37775-1RB#0-18000~27000-PASS



Band38-5MHz-16QAM-37775-1RB#24-0.009~0.15-PASS

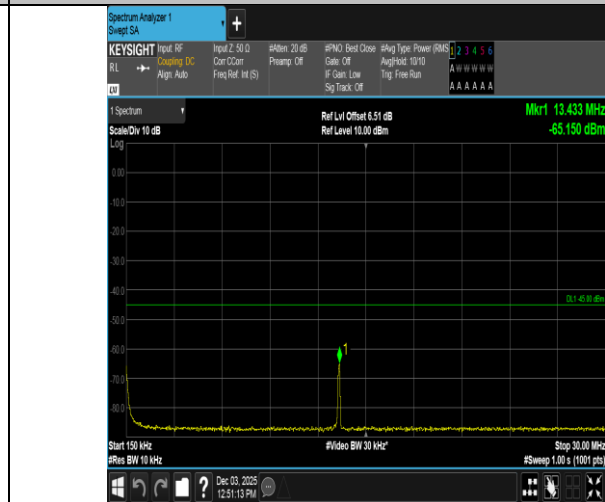

Band38-5MHz-16QAM-37775-1RB#24-0.15~30-PASS





Band38-5MHz-16QAM-37775-1RB#24-30~1000-PASS





Band38-5MHz-16QAM-37775-1RB#24-1000~3000-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

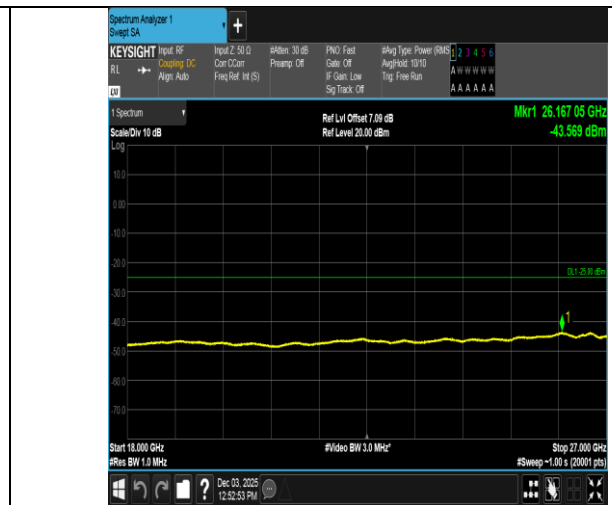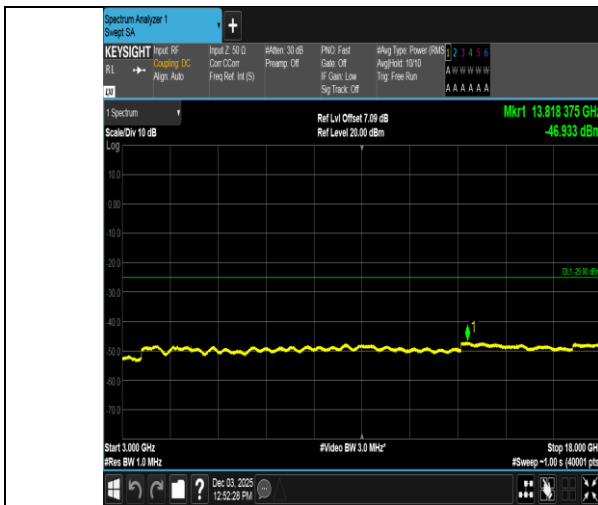


Band38-5MHz-16QAM-37775-1RB#24-3000~18000-PASS

Band38-5MHz-16QAM-37775-1RB#24-18000~27000-PASS

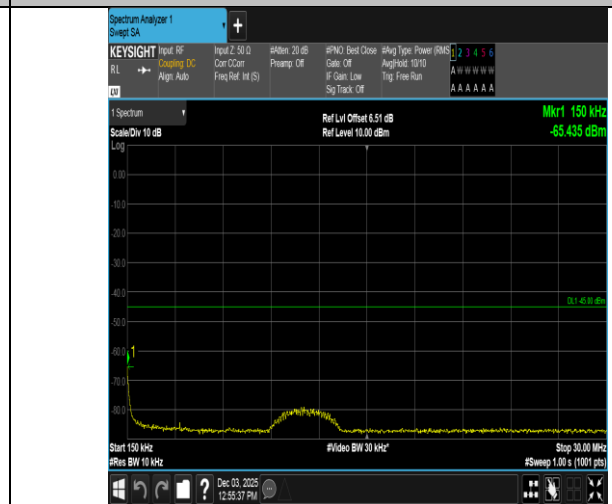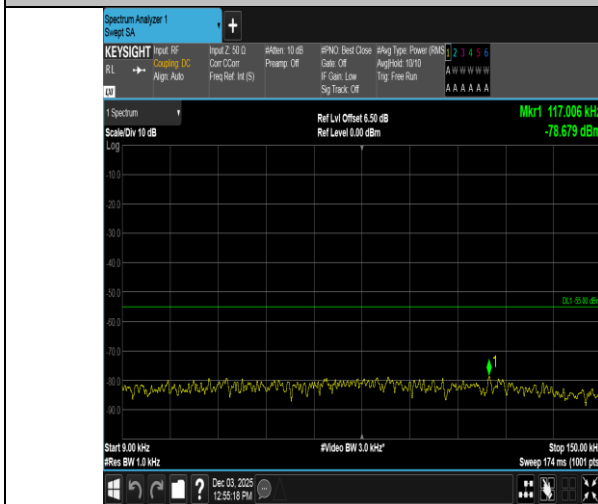

Band38-5MHz-16QAM-37775-25RB#0-0.009~0.15-PASS

Band38-5MHz-16QAM-37775-25RB#0-0.15~30-PASS

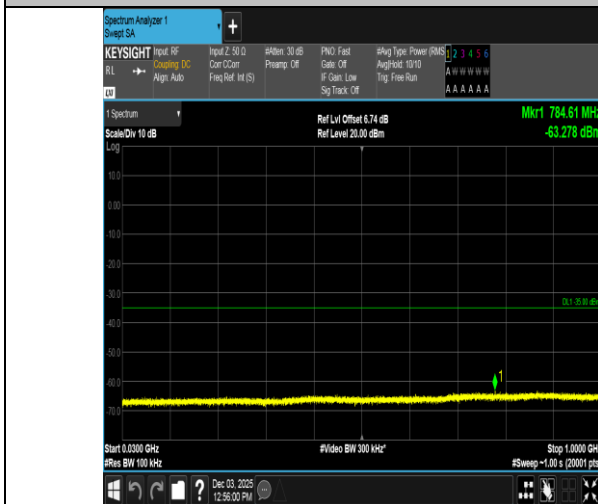

Band38-5MHz-16QAM-37775-25RB#0-30~1000-PASS

Band38-5MHz-16QAM-37775-25RB#0-1000~3000-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.