

## Appendix Test Data

|                  |                     |                    |             |
|------------------|---------------------|--------------------|-------------|
| Report No.:      | 1812C50616312503-01 | Test Sample No.:   | 1-2-2       |
| Start Test Date: | 2025-11-21          | Finish Test Date:  | 2025-12-10  |
| Test Engineer:   | Alex Peng           | Auditor:           | Justin Feng |
| Temperature:     | 23.7°C              | Relative Humidity: | 55%         |
| Pressure:        | 101kPa              |                    |             |



## Appendix A: 6dB Bandwidth

### Test Result

| Test Mode | Antenna | Frequency[MHz] | 6dB BW [MHz] | FL[MHz]  | FH[MHz]  | Limit[MHz] | Verdict |
|-----------|---------|----------------|--------------|----------|----------|------------|---------|
| 11B       | Ant1    | 2412           | 10.360       | 2406.840 | 2417.200 | 0.5        | PASS    |
| 11B       | Ant1    | 2437           | 10.360       | 2431.840 | 2442.200 | 0.5        | PASS    |
| 11B       | Ant1    | 2462           | 10.360       | 2456.840 | 2467.200 | 0.5        | PASS    |
| 11G       | Ant1    | 2412           | 16.040       | 2404.040 | 2420.080 | 0.5        | PASS    |
| 11G       | Ant1    | 2437           | 16.080       | 2429.000 | 2445.080 | 0.5        | PASS    |
| 11G       | Ant1    | 2462           | 16.080       | 2453.960 | 2470.040 | 0.5        | PASS    |
| 11N20SISO | Ant1    | 2412           | 17.080       | 2403.480 | 2420.560 | 0.5        | PASS    |
| 11N20SISO | Ant1    | 2437           | 17.240       | 2428.480 | 2445.720 | 0.5        | PASS    |
| 11N20SISO | Ant1    | 2462           | 17.240       | 2453.440 | 2470.680 | 0.5        | PASS    |
| 11N40SISO | Ant1    | 2422           | 35.600       | 2404.240 | 2439.840 | 0.5        | PASS    |
| 11N40SISO | Ant1    | 2437           | 35.600       | 2419.320 | 2454.920 | 0.5        | PASS    |
| 11N40SISO | Ant1    | 2452           | 35.840       | 2434.160 | 2470.000 | 0.5        | PASS    |


## Test Graphs



## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

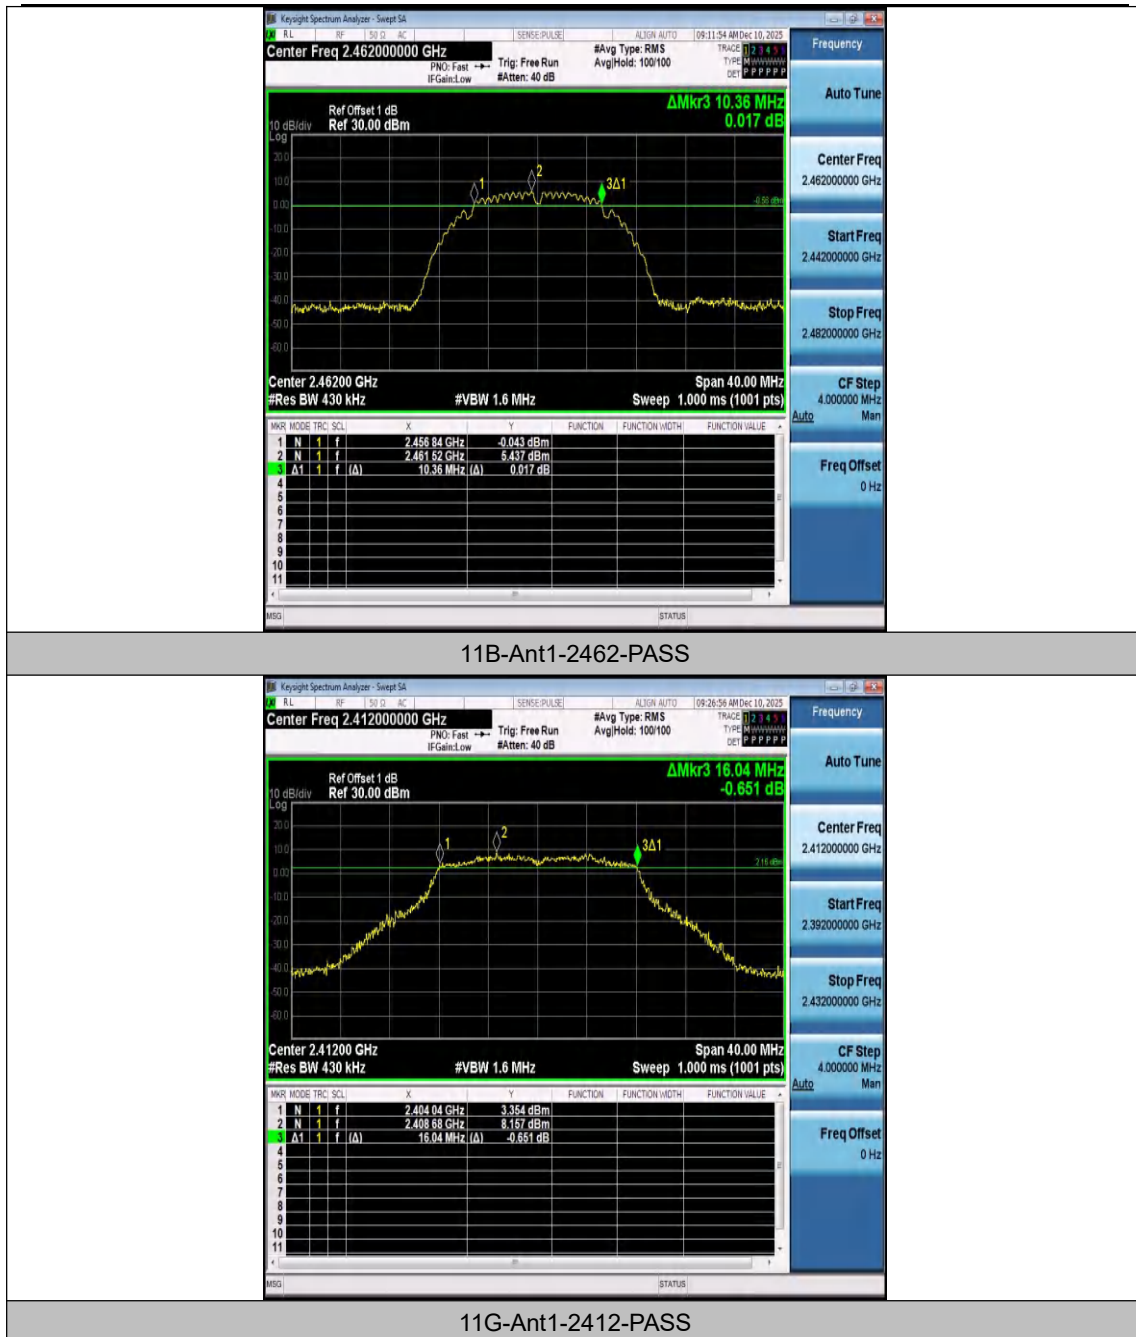




### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)




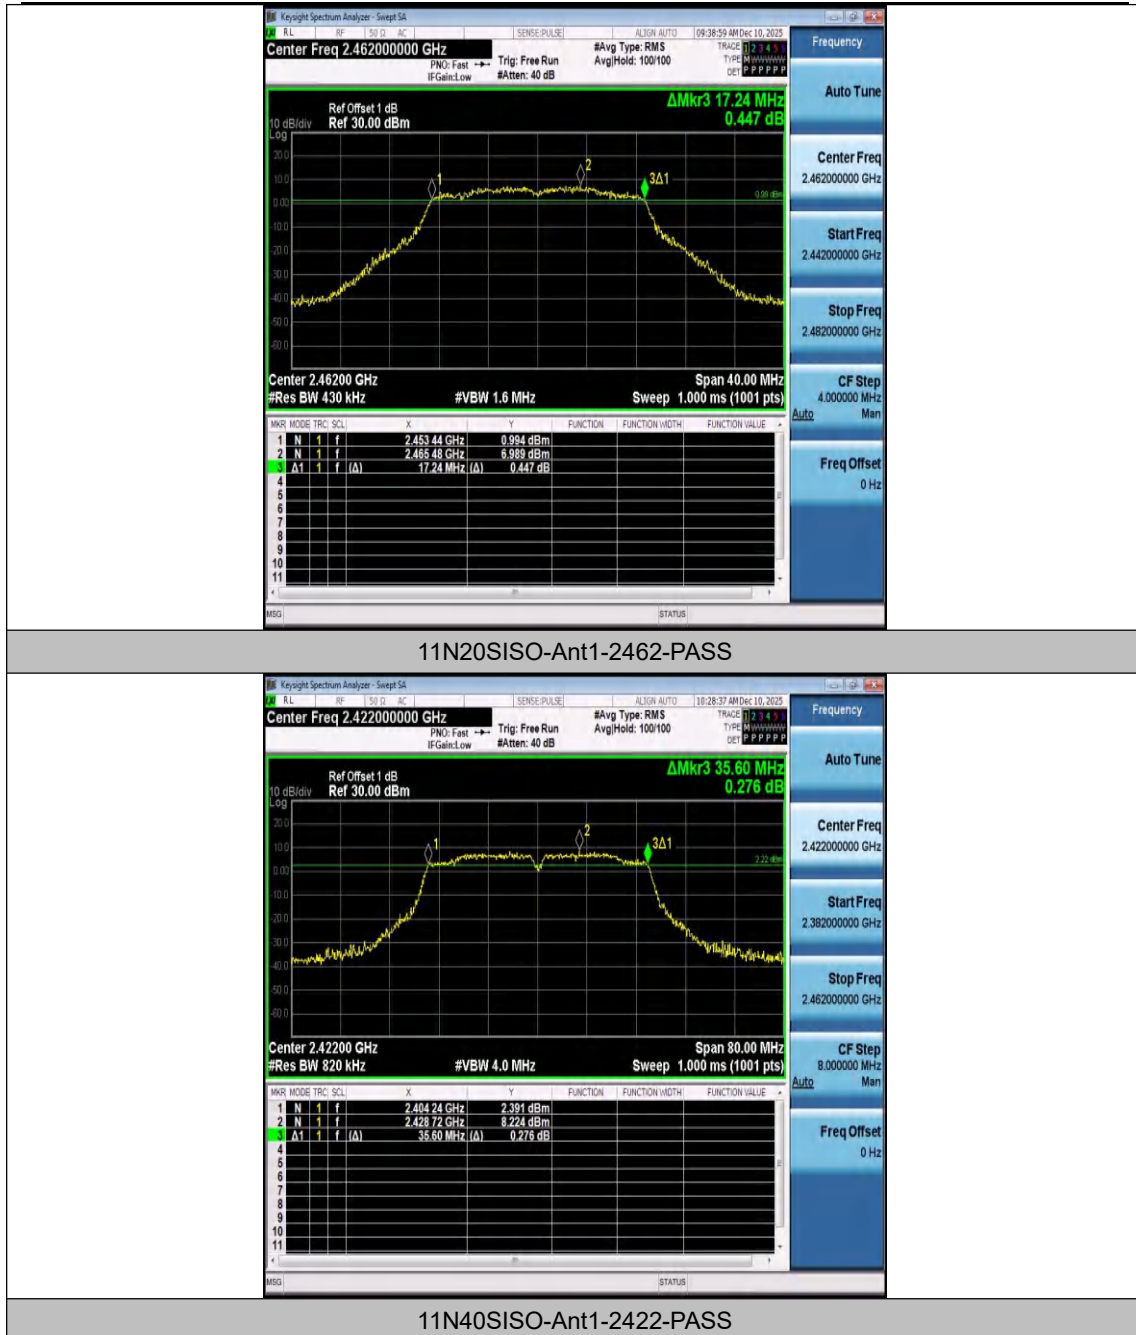

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

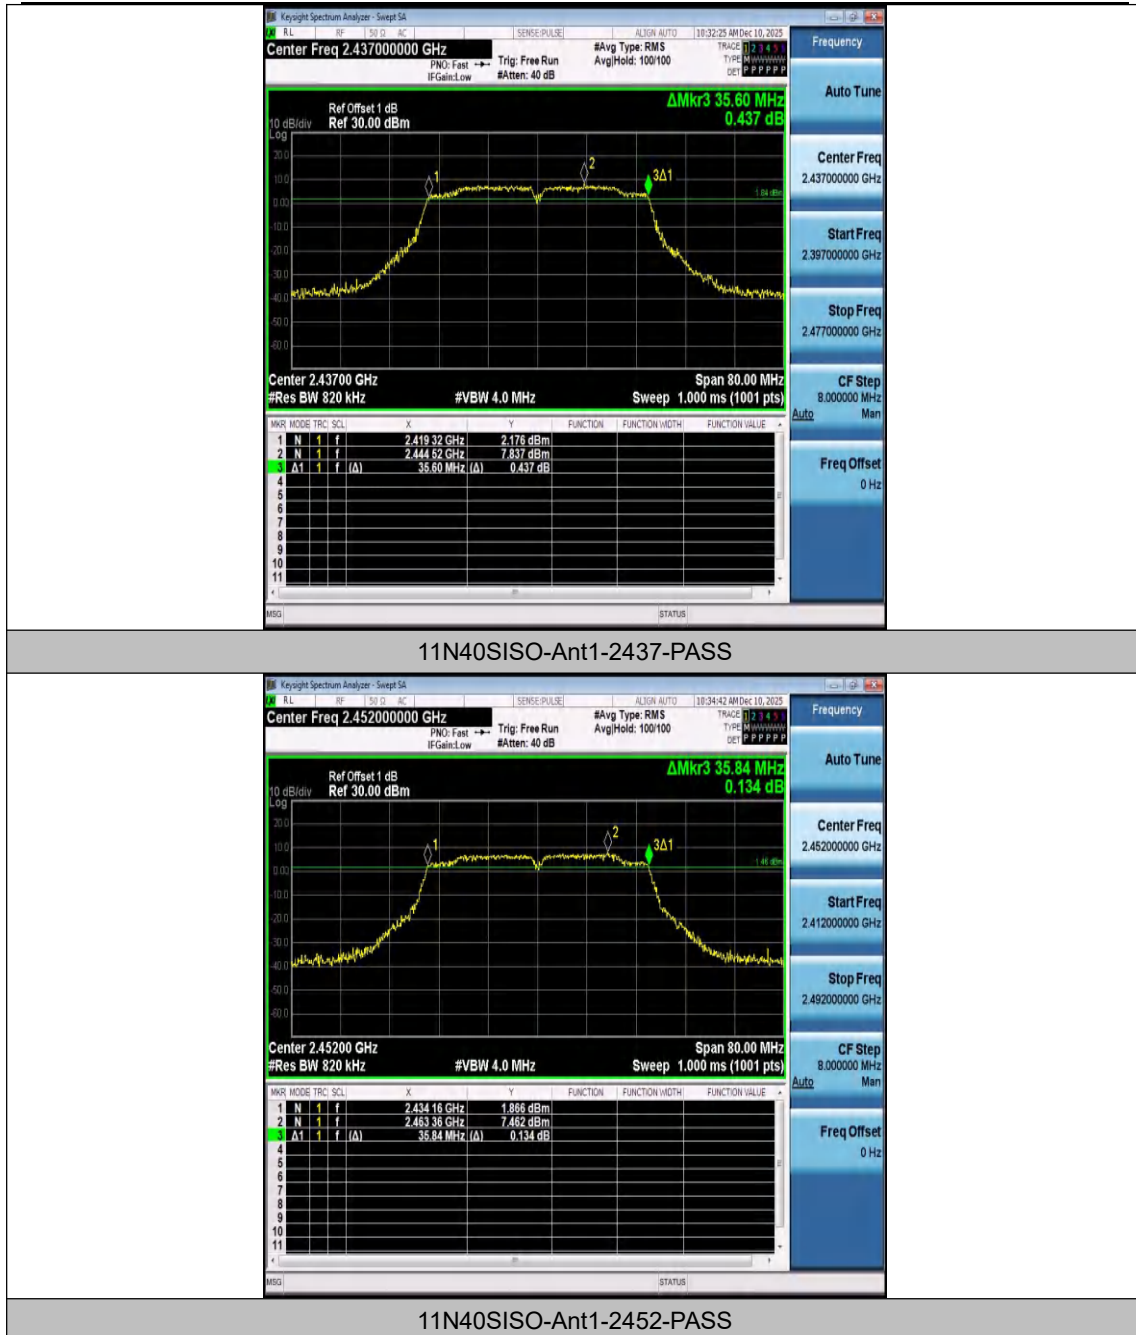

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix B: 99% Occupied Bandwidth

### Test Result

| Test Mode | Antenna | Channel Frequency[MHz] | OCB [MHz] | FL[MHz]   | FH[MHz]   | Limit[MHz] | Verdict |
|-----------|---------|------------------------|-----------|-----------|-----------|------------|---------|
| 11B       | Ant1    | 2412                   | 13.424    | 2405.2911 | 2418.7151 | ---        | ---     |
| 11B       | Ant1    | 2437                   | 13.434    | 2430.2933 | 2443.7273 | ---        | ---     |
| 11B       | Ant1    | 2462                   | 13.434    | 2455.3062 | 2468.7402 | ---        | ---     |
| 11G       | Ant1    | 2412                   | 16.876    | 2403.5529 | 2420.4289 | ---        | ---     |
| 11G       | Ant1    | 2437                   | 16.876    | 2428.6018 | 2445.4778 | ---        | ---     |
| 11G       | Ant1    | 2462                   | 16.882    | 2453.5851 | 2470.4671 | ---        | ---     |
| 11N20SISO | Ant1    | 2412                   | 17.911    | 2403.0389 | 2420.9499 | ---        | ---     |
| 11N20SISO | Ant1    | 2437                   | 17.943    | 2428.0469 | 2445.9899 | ---        | ---     |
| 11N20SISO | Ant1    | 2462                   | 17.903    | 2453.0762 | 2470.9792 | ---        | ---     |
| 11N40SISO | Ant1    | 2422                   | 36.069    | 2404.0249 | 2440.0939 | ---        | ---     |
| 11N40SISO | Ant1    | 2437                   | 36.093    | 2419.0419 | 2455.1349 | ---        | ---     |
| 11N40SISO | Ant1    | 2452                   | 36.030    | 2434.0827 | 2470.1127 | ---        | ---     |

## Test Graphs

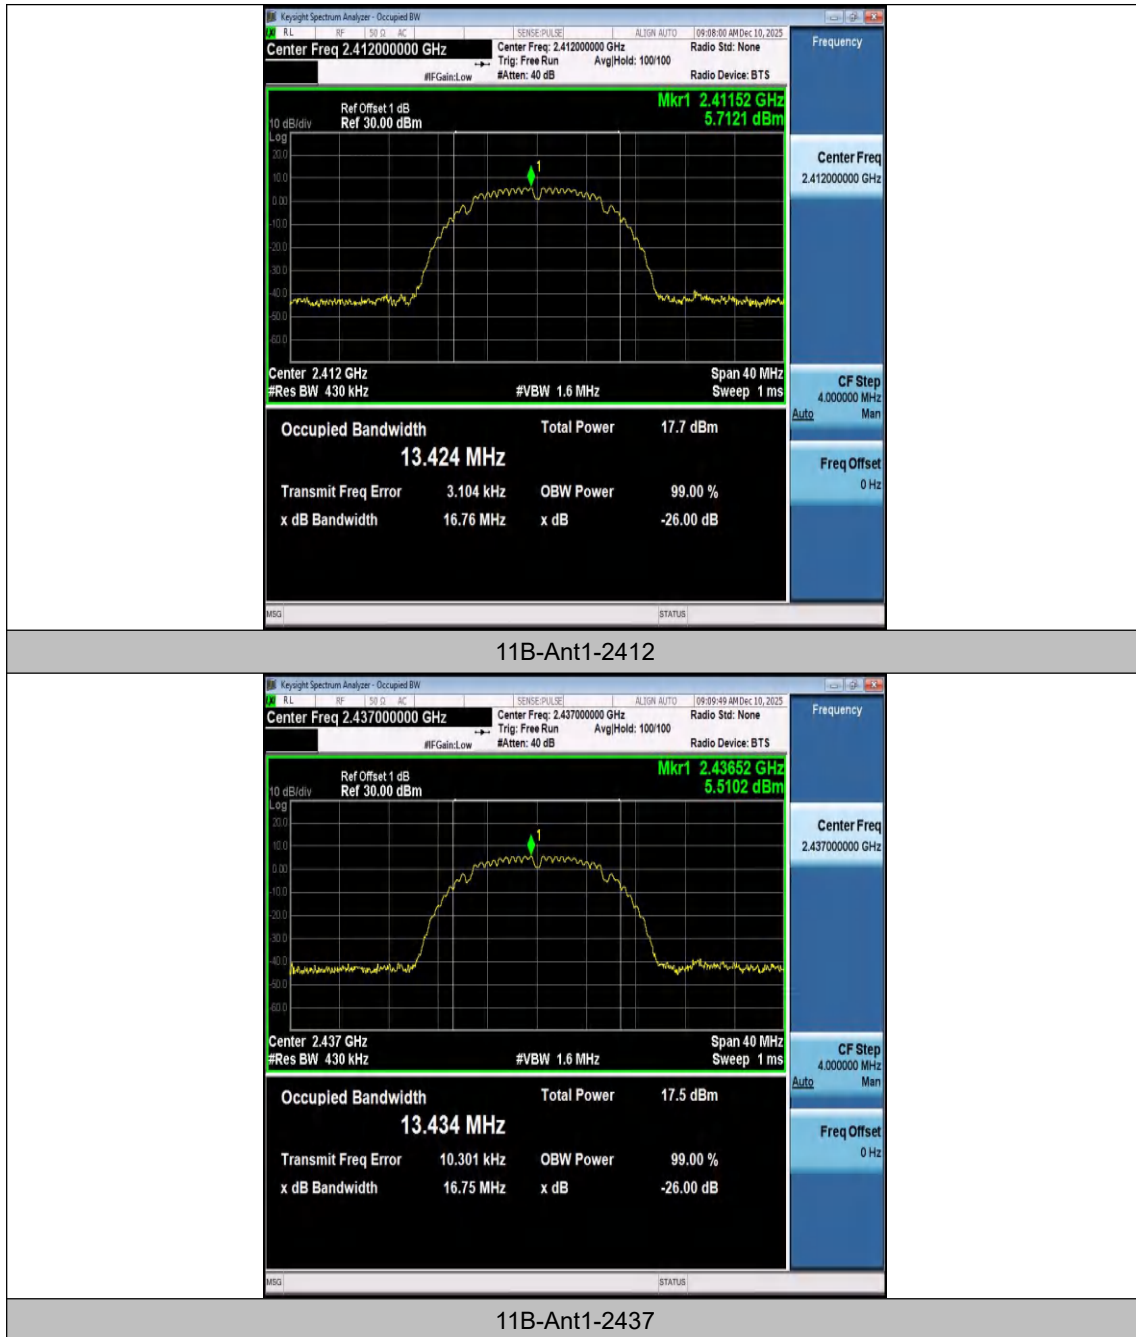

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)



### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)





### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)



### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

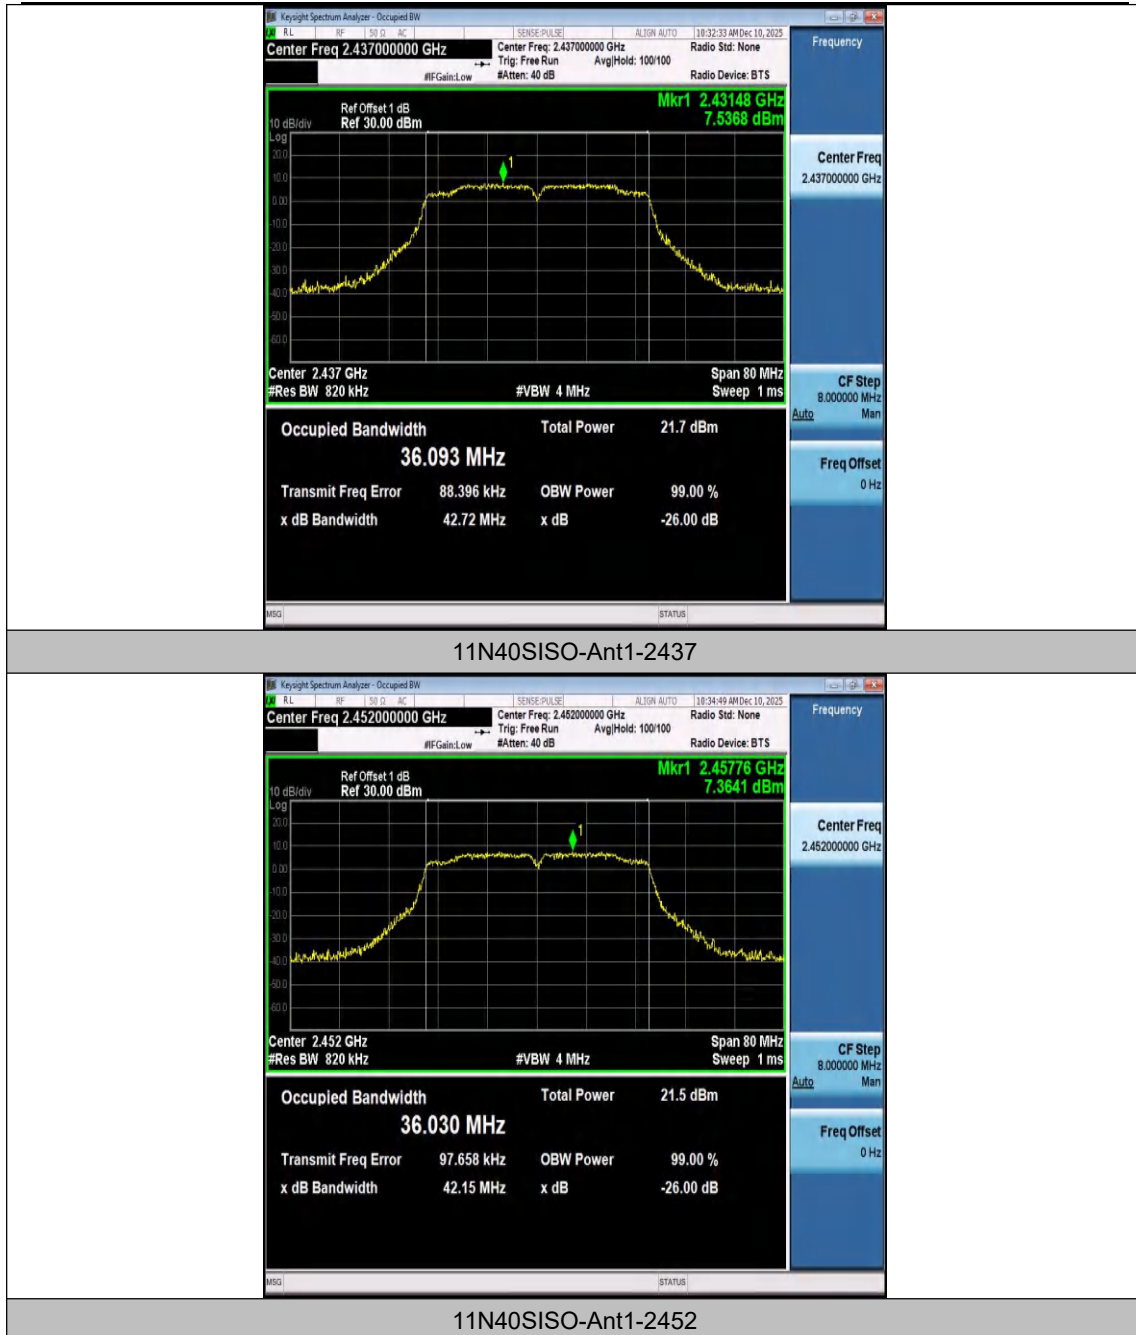

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Appendix C: Maximum conducted output power

### Test Result Average

| Test Mode | Antenna | Frequency[MHz] | Result [dBm] | Limit [dBm] | Verdict |
|-----------|---------|----------------|--------------|-------------|---------|
| 11B       | Ant1    | 2412           | 14.80        | ≤30.00      | PASS    |
| 11B       | Ant1    | 2437           | 14.56        | ≤30.00      | PASS    |
| 11B       | Ant1    | 2462           | 14.43        | ≤30.00      | PASS    |
| 11G       | Ant1    | 2412           | 14.80        | ≤30.00      | PASS    |
| 11G       | Ant1    | 2437           | 14.54        | ≤30.00      | PASS    |
| 11G       | Ant1    | 2462           | 14.43        | ≤30.00      | PASS    |
| 11N20SISO | Ant1    | 2412           | 14.69        | ≤30.00      | PASS    |
| 11N20SISO | Ant1    | 2437           | 14.43        | ≤30.00      | PASS    |
| 11N20SISO | Ant1    | 2462           | 14.28        | ≤30.00      | PASS    |
| 11N40SISO | Ant1    | 2422           | 14.61        | ≤30.00      | PASS    |
| 11N40SISO | Ant1    | 2437           | 14.59        | ≤30.00      | PASS    |
| 11N40SISO | Ant1    | 2452           | 14.42        | ≤30.00      | PASS    |

Note: The cable loss are compensated in the graph.


## Test Graphs Average

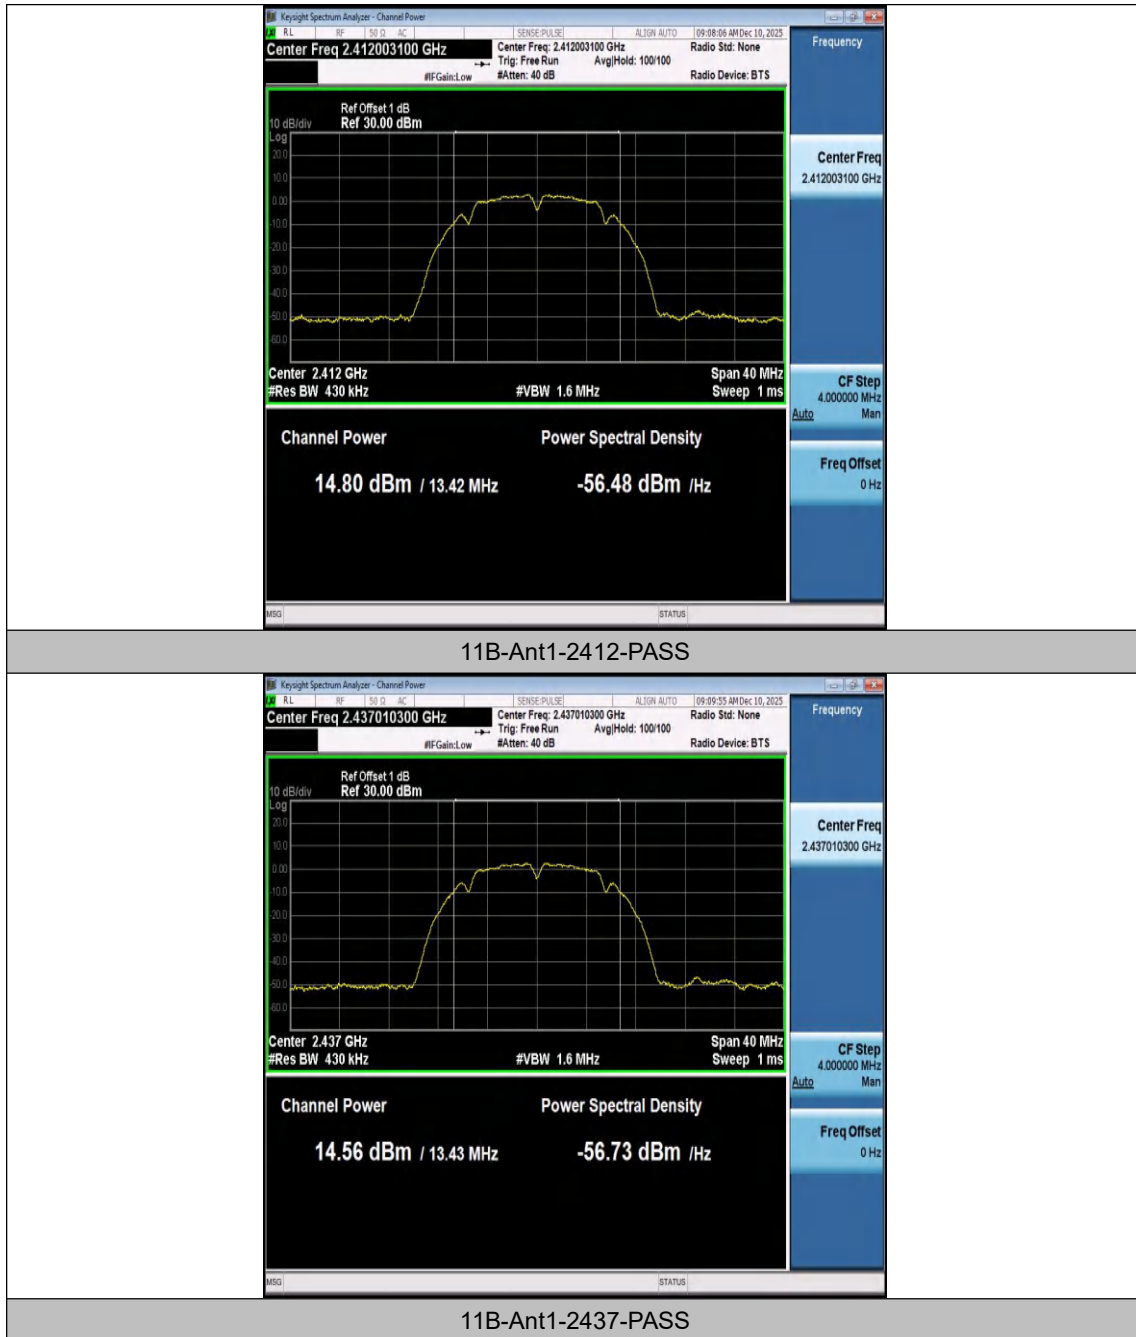


## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

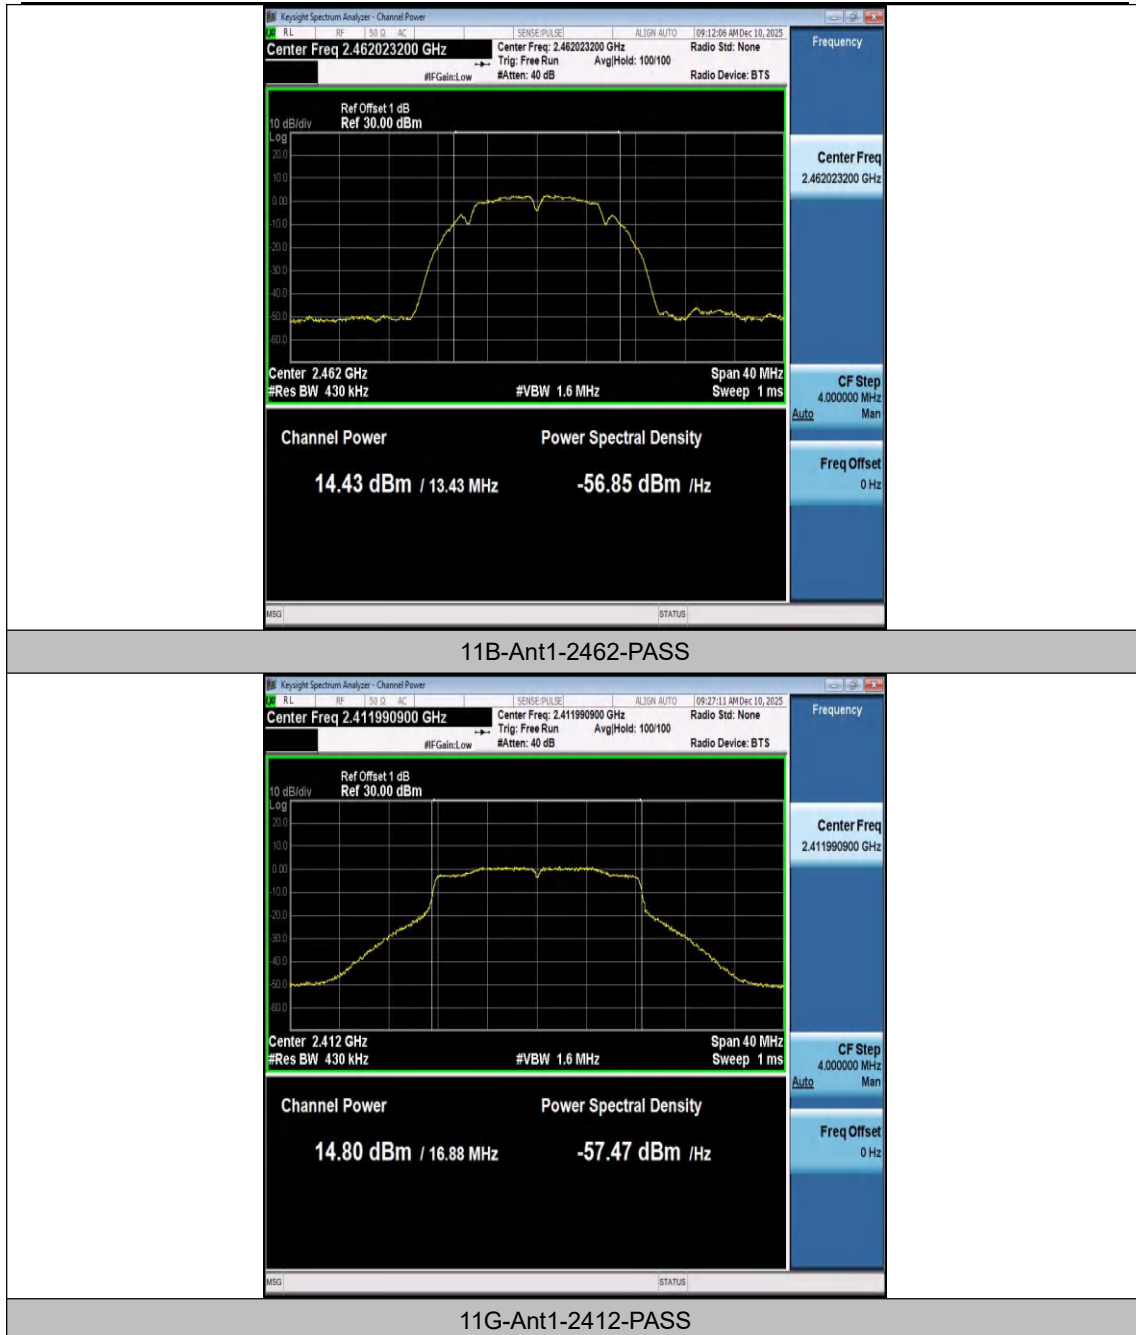


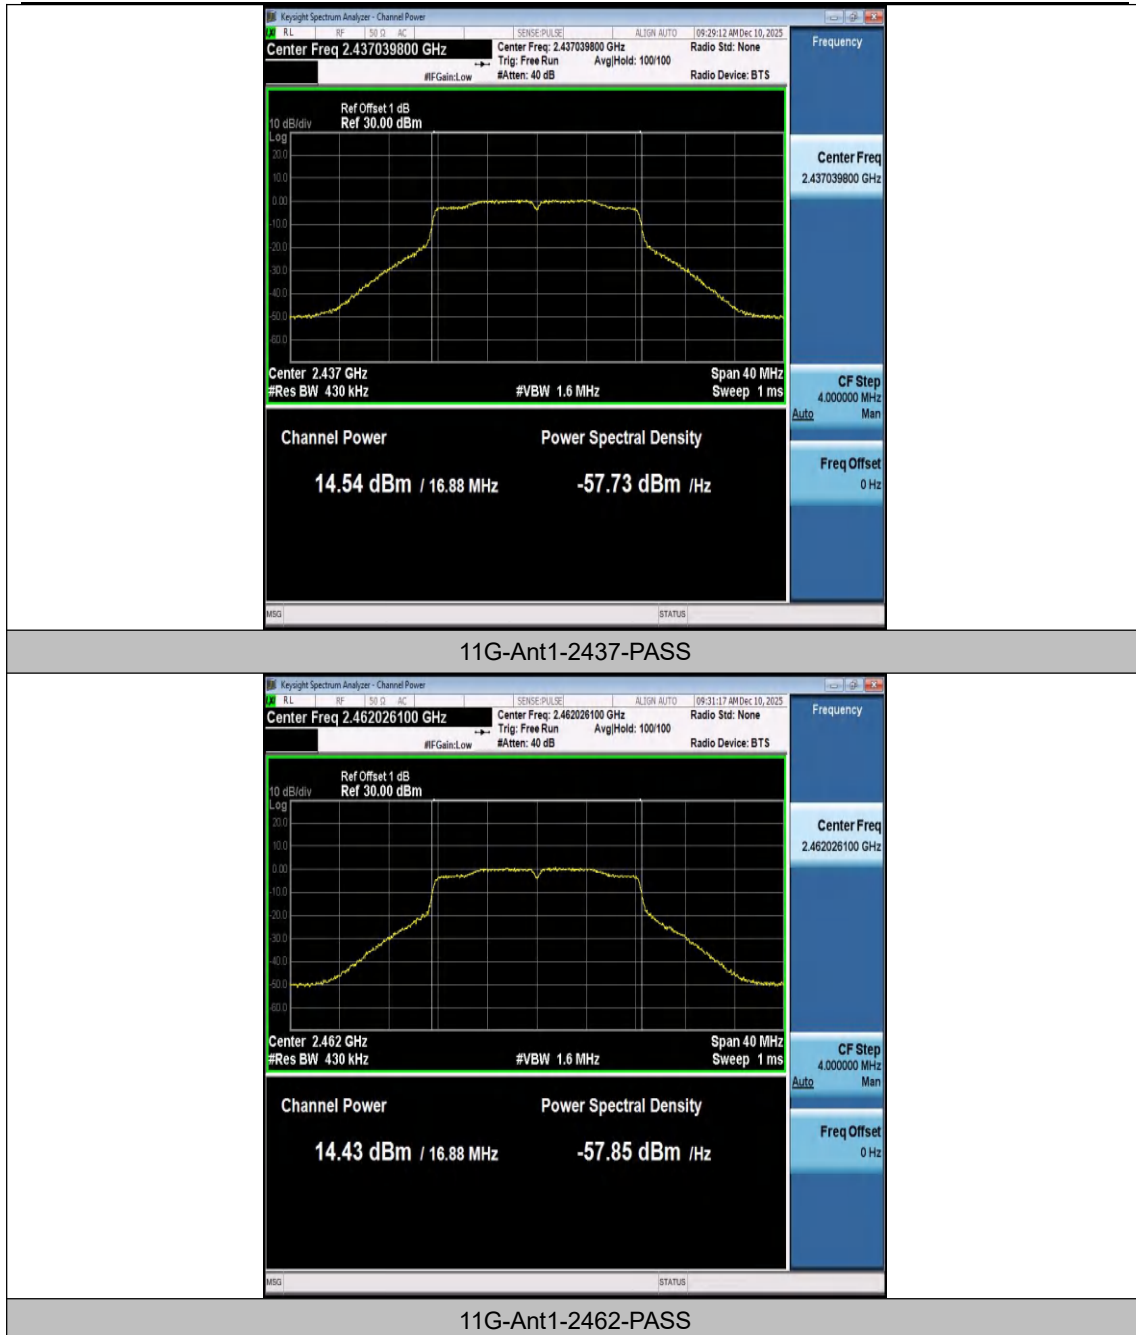

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

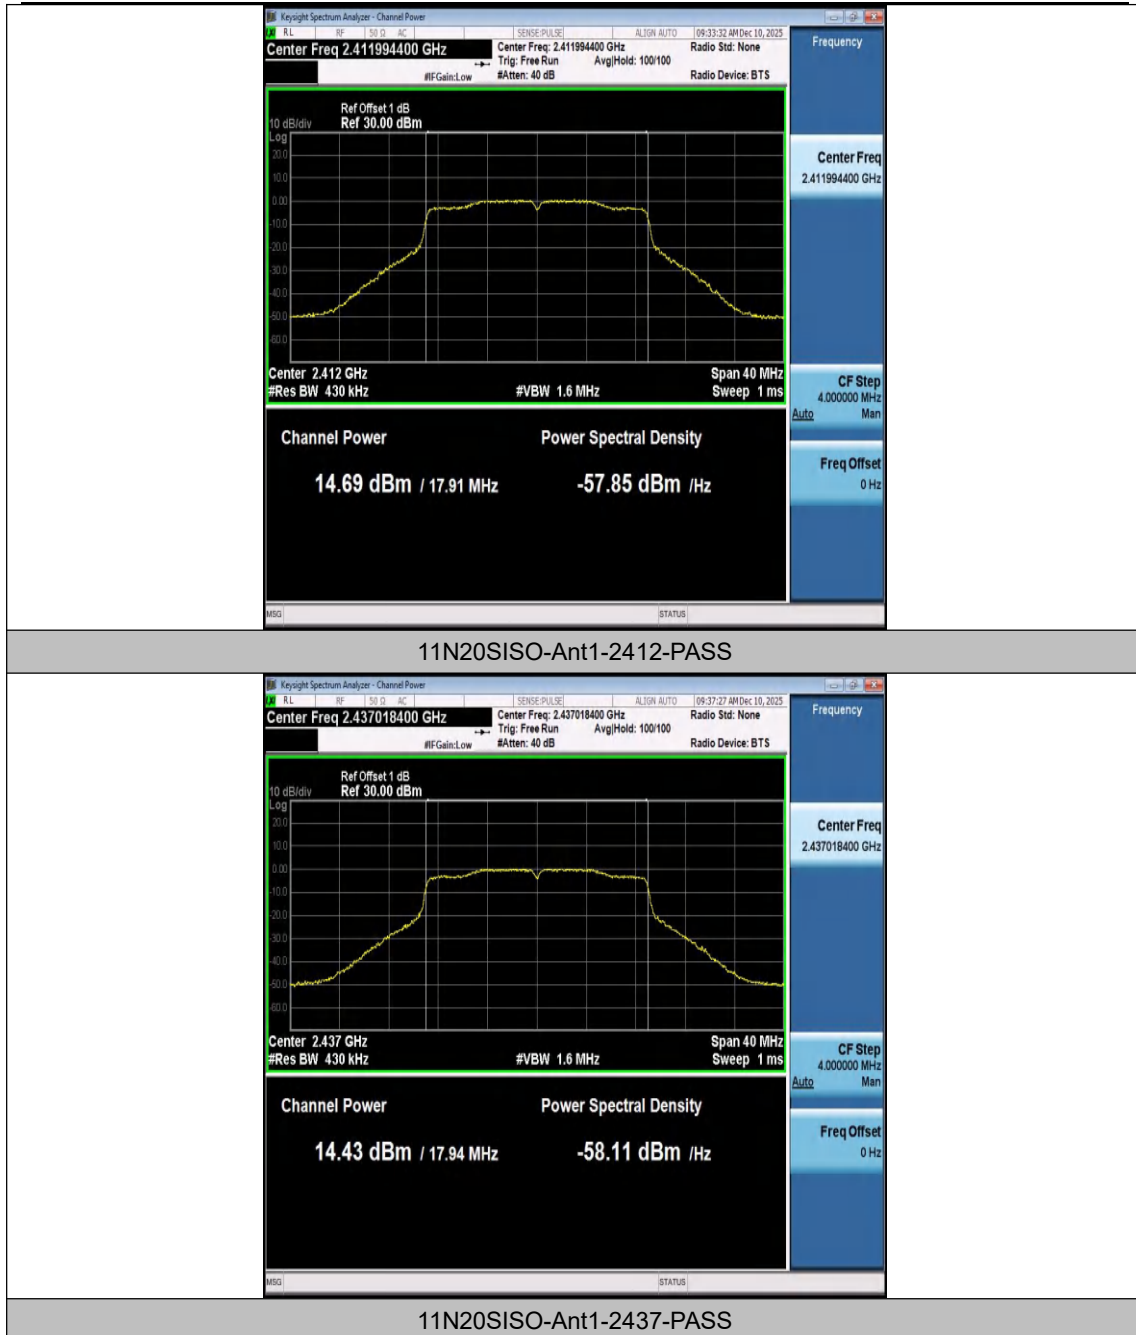

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

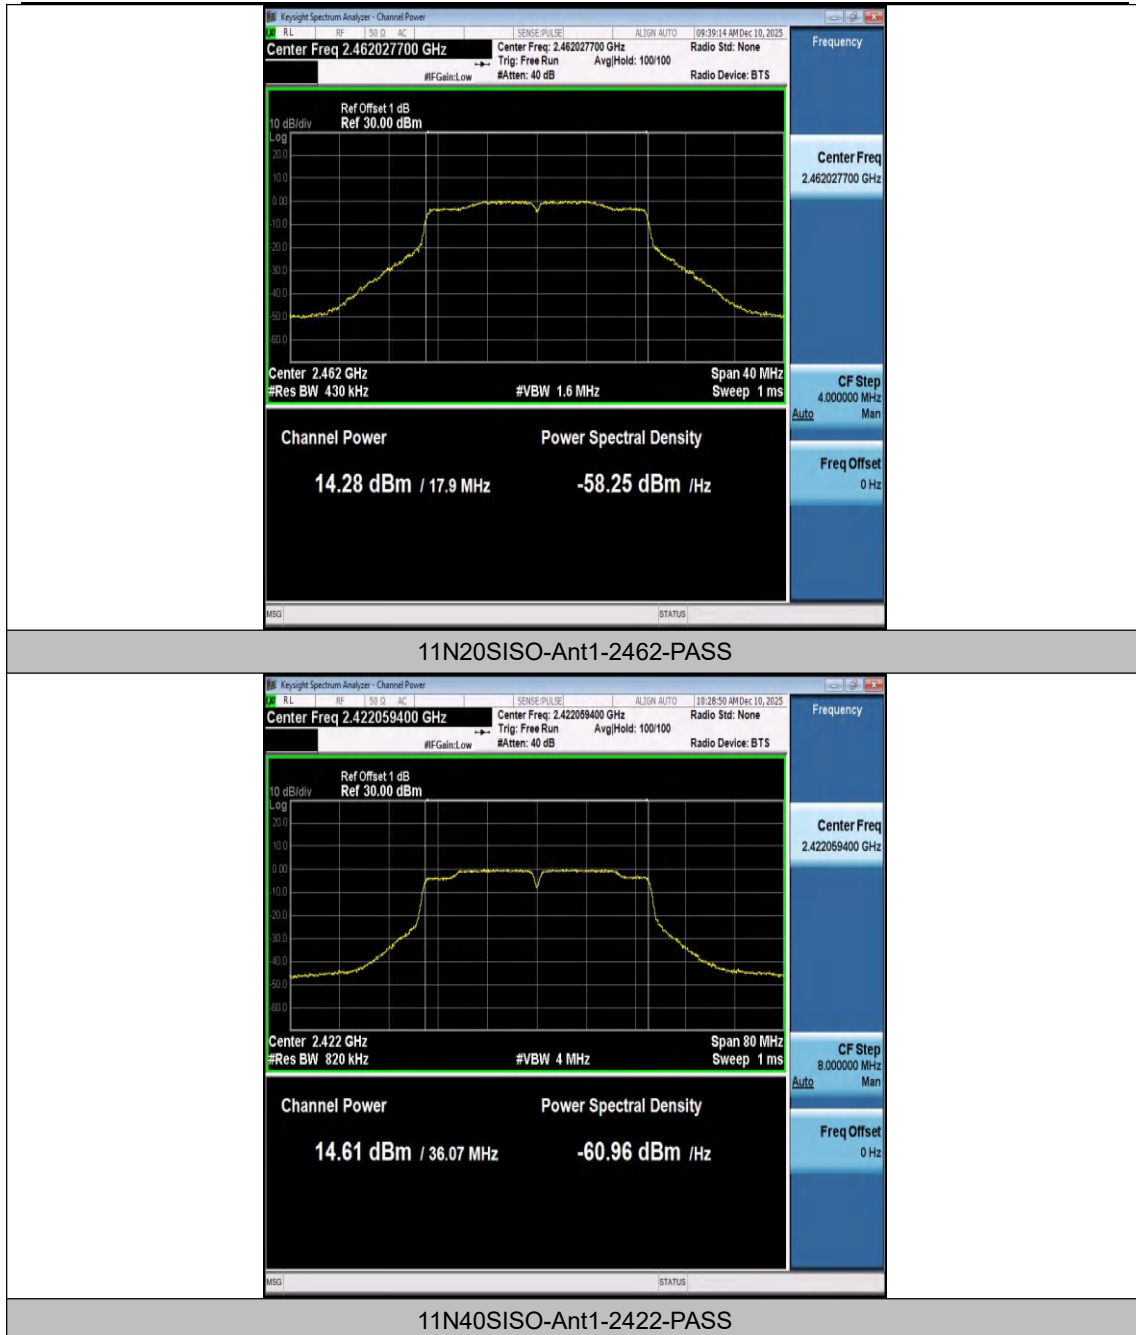

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

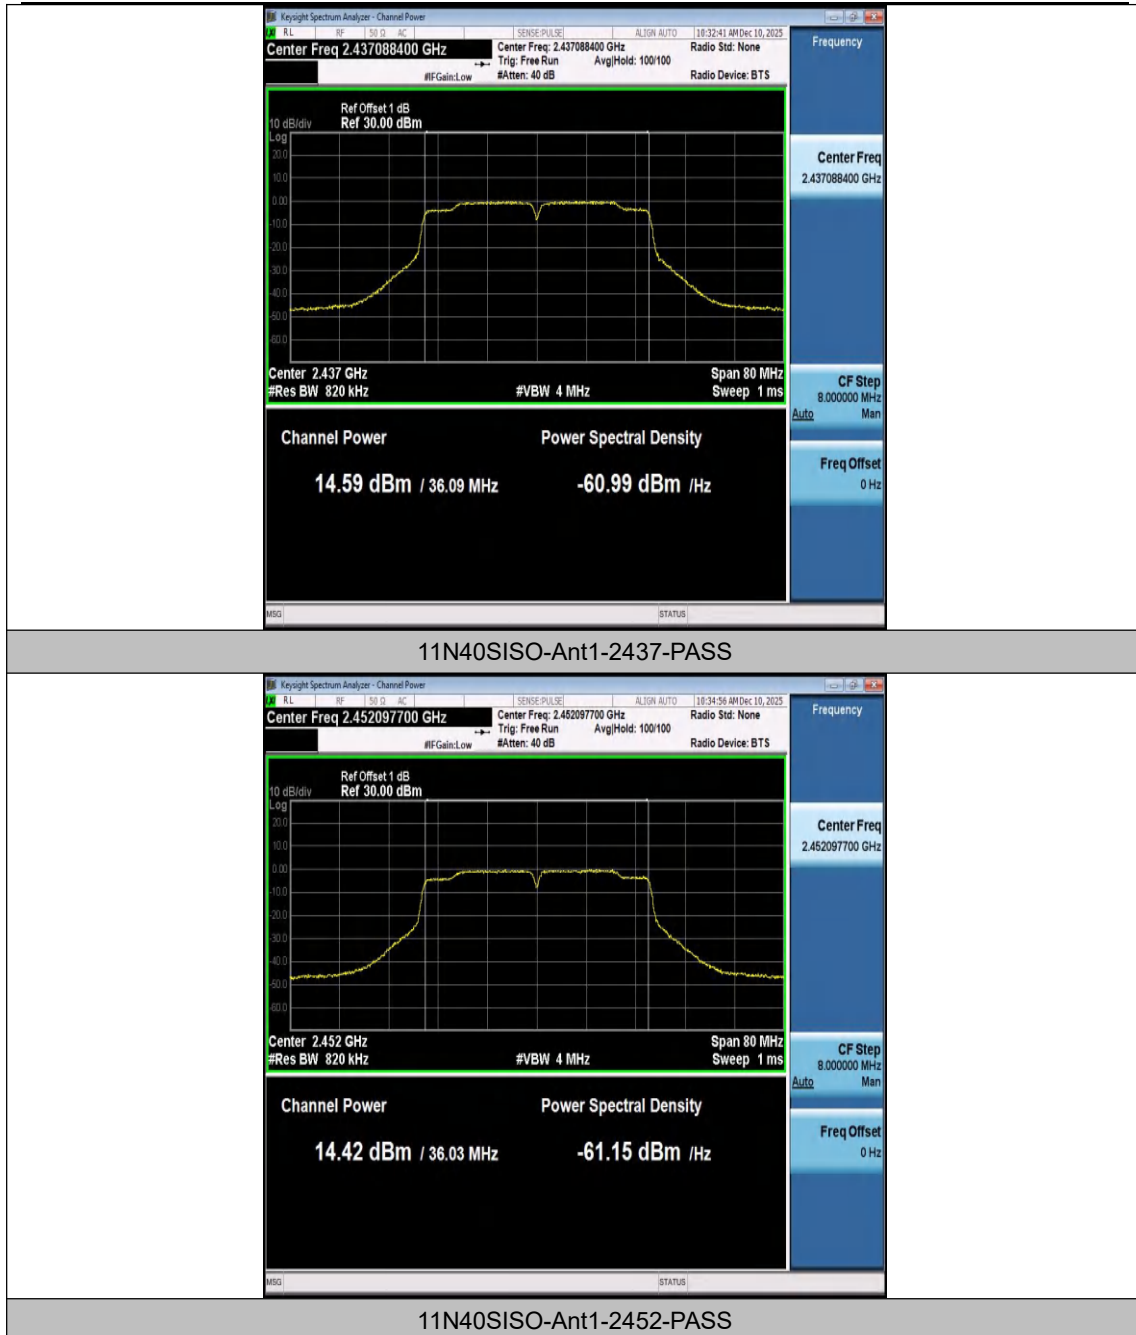

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix D: Maximum power spectral density


### Test Result

| Test Mode | Antenna | Frequency[MHz] | Result[dBm/30kHz] | Limit[dBm/3kHz] | Verdict |
|-----------|---------|----------------|-------------------|-----------------|---------|
| 11B       | Ant1    | 2412           | -7.63             | ≤8.00           | PASS    |
| 11B       | Ant1    | 2437           | -7.60             | ≤8.00           | PASS    |
| 11B       | Ant1    | 2462           | -7.79             | ≤8.00           | PASS    |
| 11G       | Ant1    | 2412           | -8.43             | ≤8.00           | PASS    |
| 11G       | Ant1    | 2437           | -8.89             | ≤8.00           | PASS    |
| 11G       | Ant1    | 2462           | -9.07             | ≤8.00           | PASS    |
| 11N20SISO | Ant1    | 2412           | -8.88             | ≤8.00           | PASS    |
| 11N20SISO | Ant1    | 2437           | -9.64             | ≤8.00           | PASS    |
| 11N20SISO | Ant1    | 2462           | -9.52             | ≤8.00           | PASS    |
| 11N40SISO | Ant1    | 2422           | -12.10            | ≤8.00           | PASS    |
| 11N40SISO | Ant1    | 2437           | -11.59            | ≤8.00           | PASS    |
| 11N40SISO | Ant1    | 2452           | -12.19            | ≤8.00           | PASS    |

**Note:**

1. The cable loss are compensated in the graph.


## Test Graphs

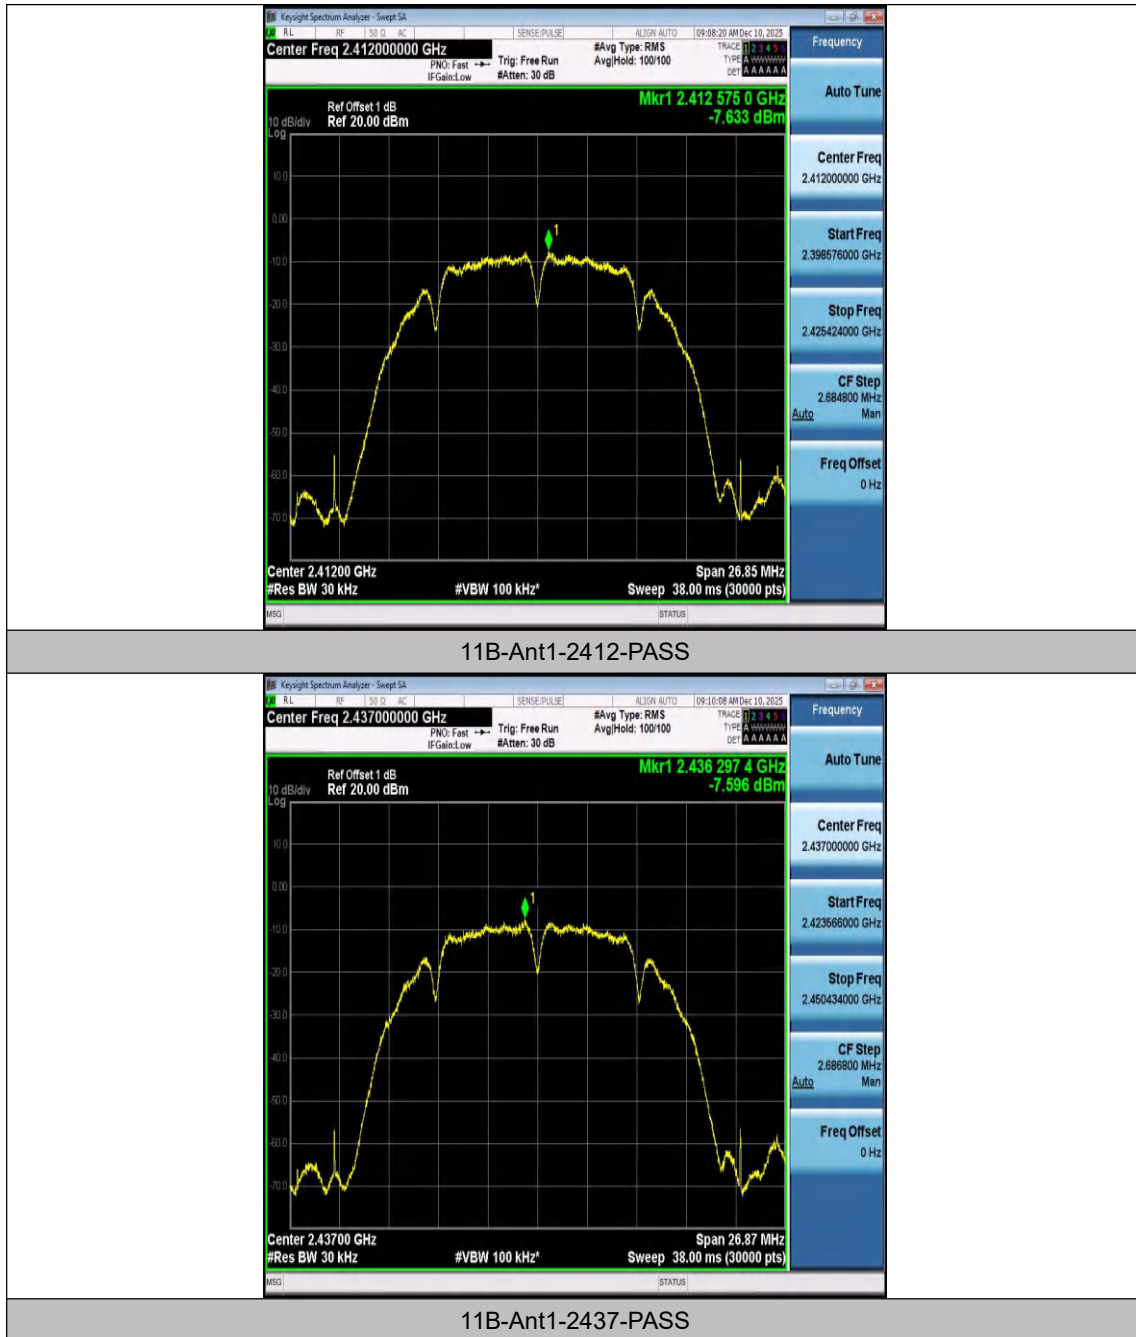

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

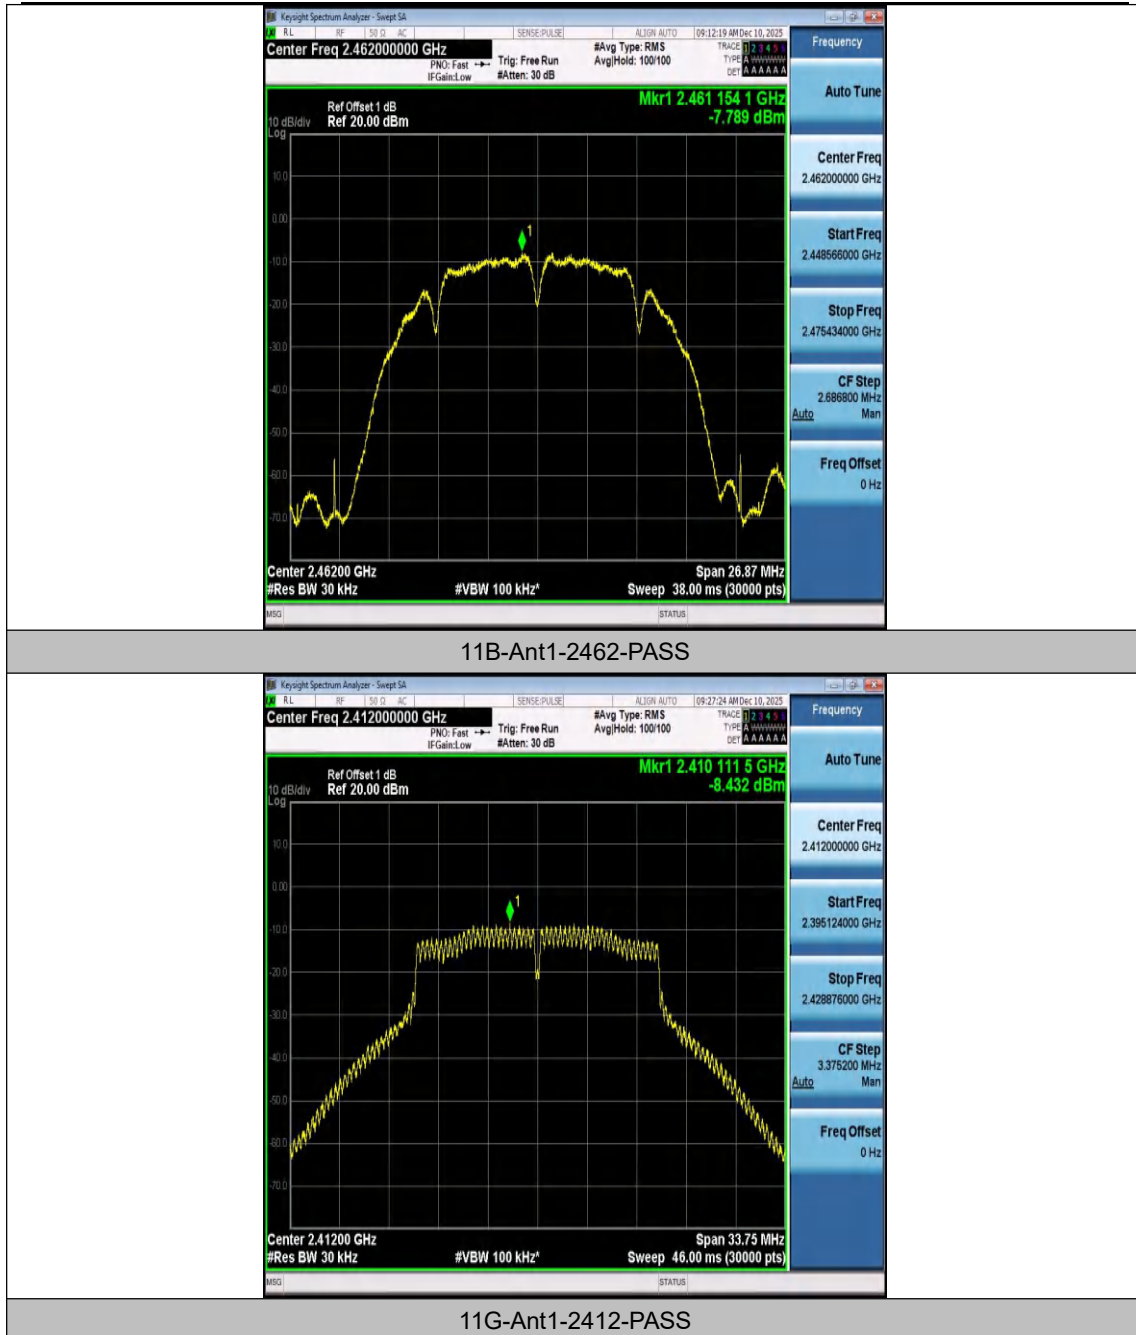

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

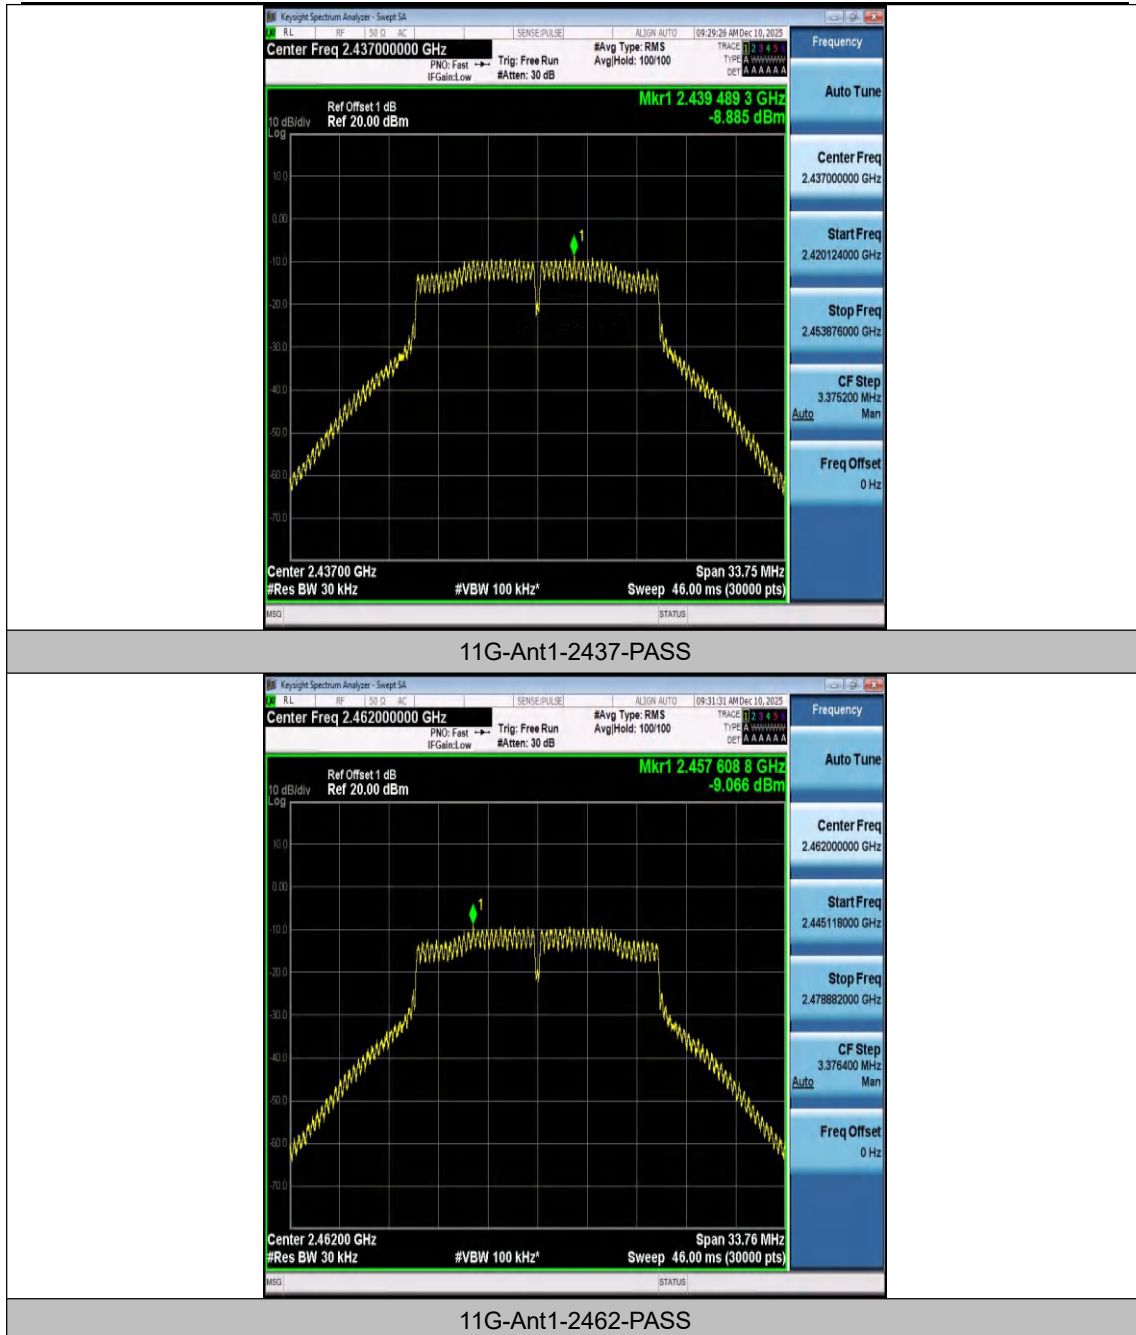

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

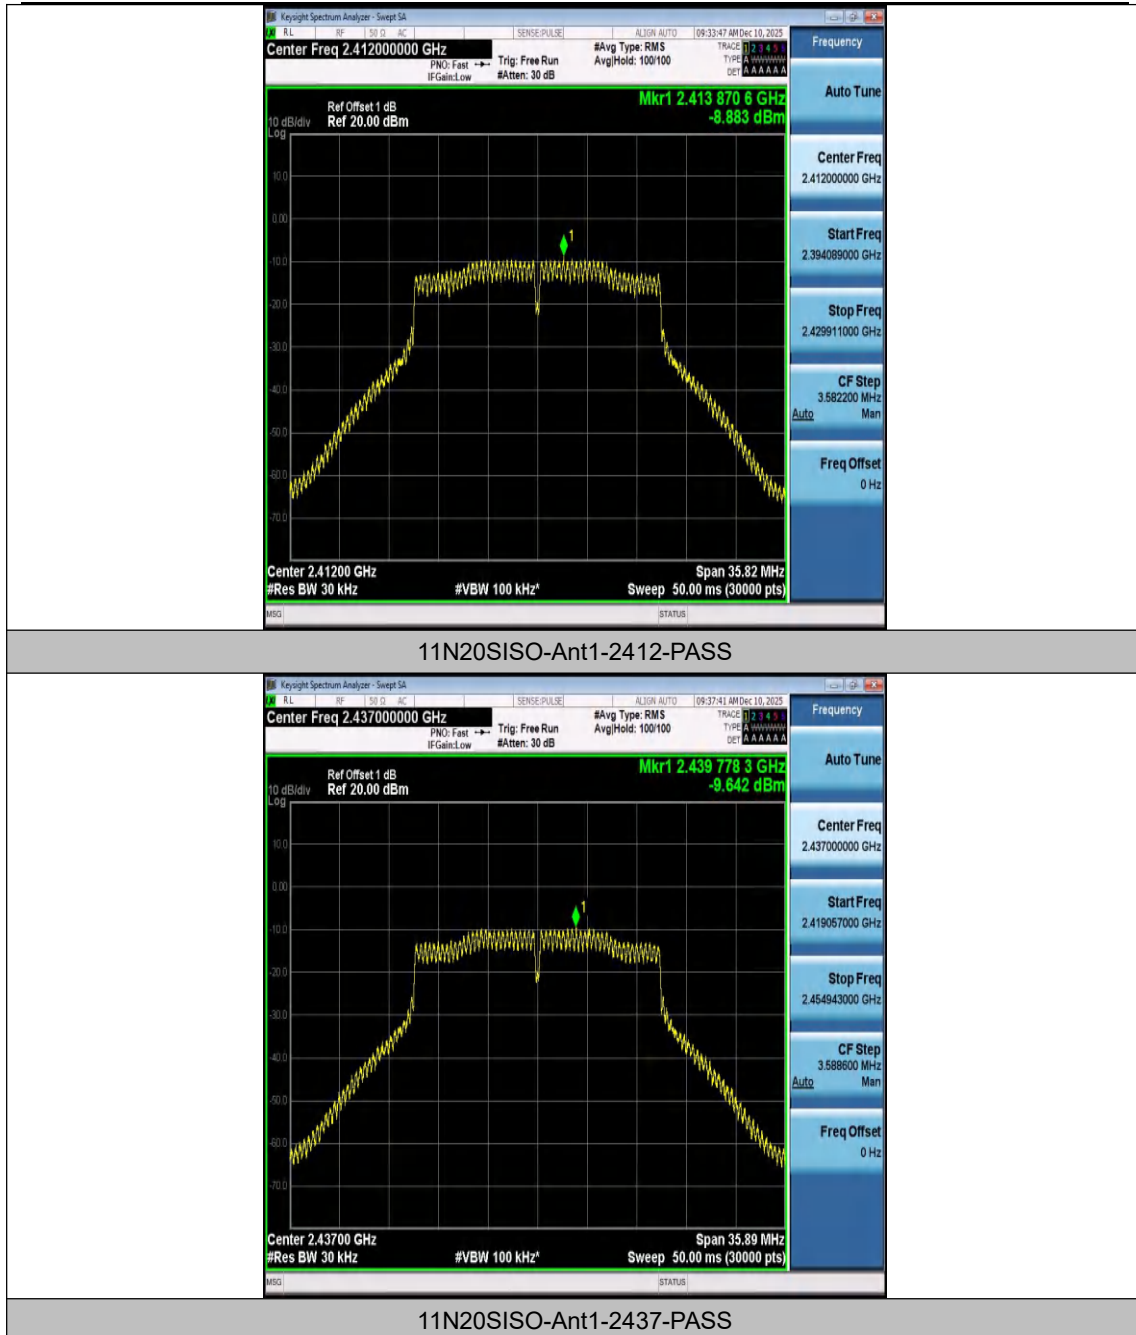

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

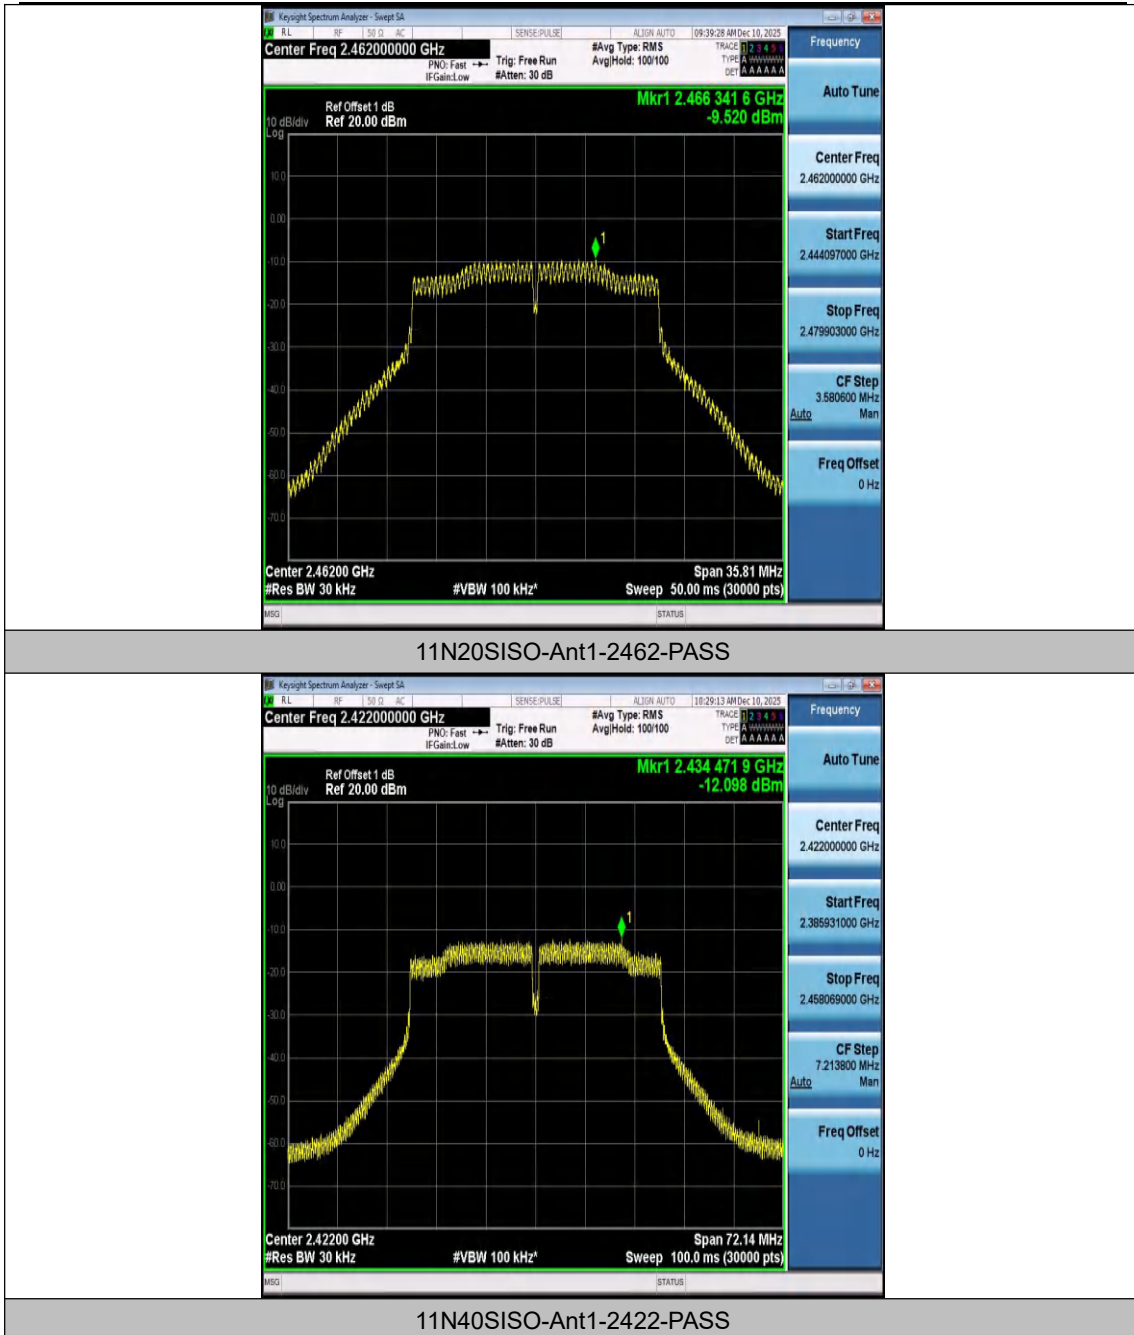

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

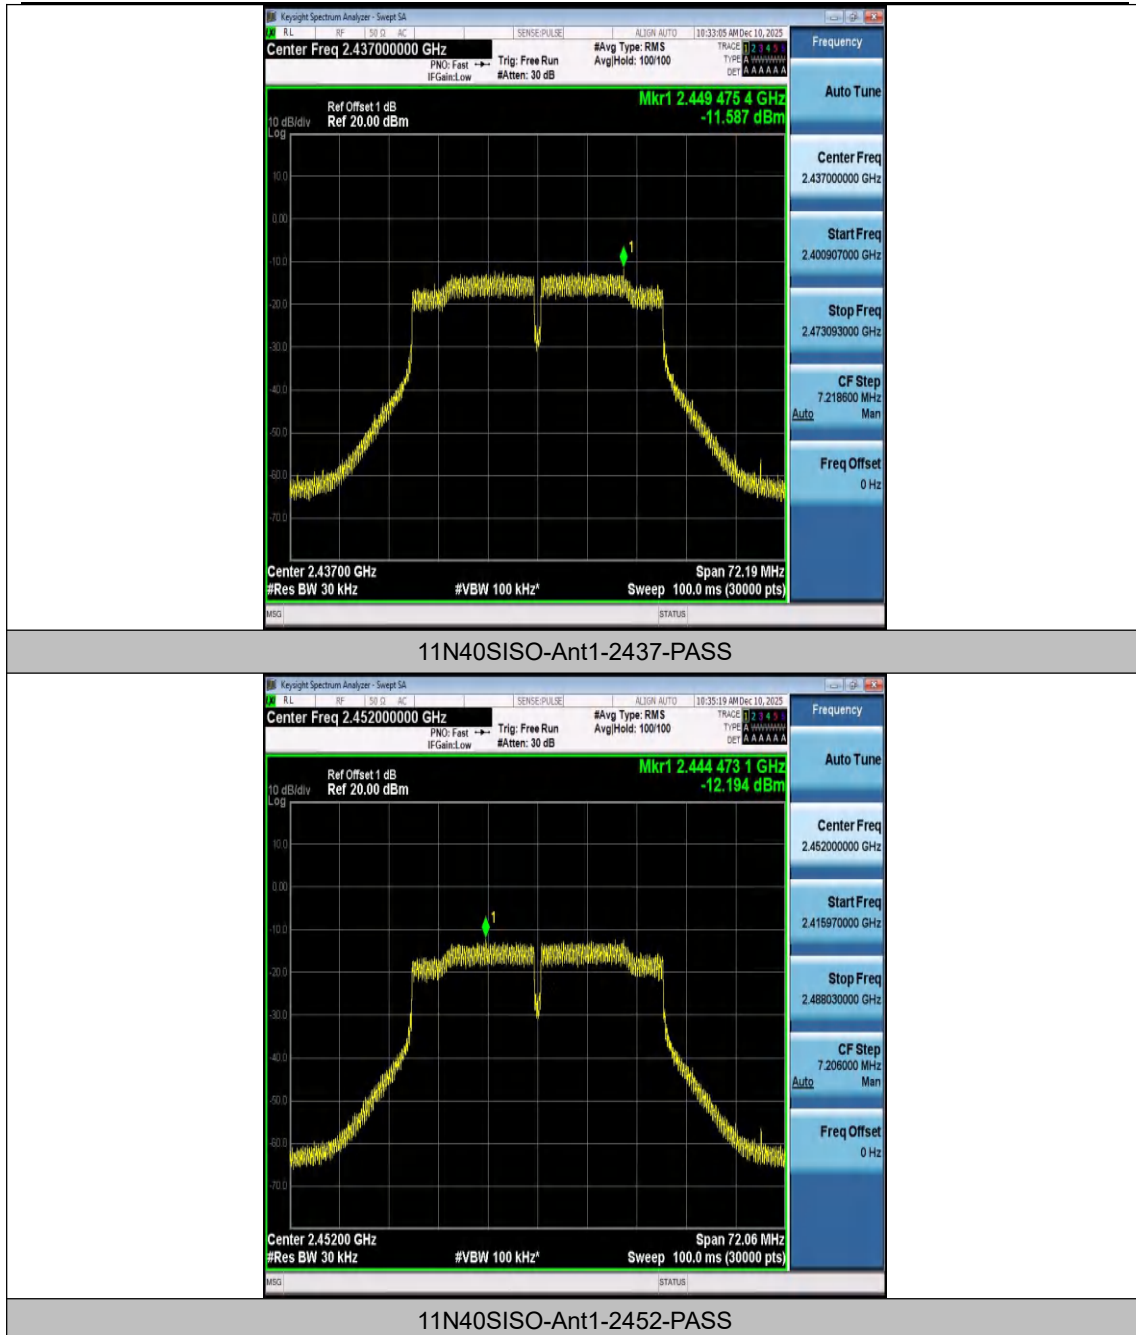

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Appendix E: Conducted Band edge


### Test Result


| Test Mode | Antenna | Ch. Name | Frequency[MHz] | Ref. Level[dBm] | Result[dBm] | Limit[dBm] | Verdict |
|-----------|---------|----------|----------------|-----------------|-------------|------------|---------|
| 11B       | Ant1    | Low      | 2412           | 4.63            | -25.38      | ≤-25.37    | PASS    |
| 11B       | Ant1    | High     | 2462           | 4.57            | -50.52      | ≤-25.43    | PASS    |
| 11G       | Ant1    | Low      | 2412           | 4.84            | -26.1       | ≤-25.16    | PASS    |
| 11G       | Ant1    | High     | 2462           | 4.50            | -51.28      | ≤-25.5     | PASS    |
| 11N20SISO | Ant1    | Low      | 2412           | 4.74            | -27.13      | ≤-25.26    | PASS    |
| 11N20SISO | Ant1    | High     | 2462           | 4.28            | -50.32      | ≤-25.72    | PASS    |
| 11N40SISO | Ant1    | Low      | 2422           | 1.07            | -29.51      | ≤-28.93    | PASS    |
| 11N40SISO | Ant1    | High     | 2452           | 0.98            | -40.63      | ≤-29.03    | PASS    |

## Test Graphs

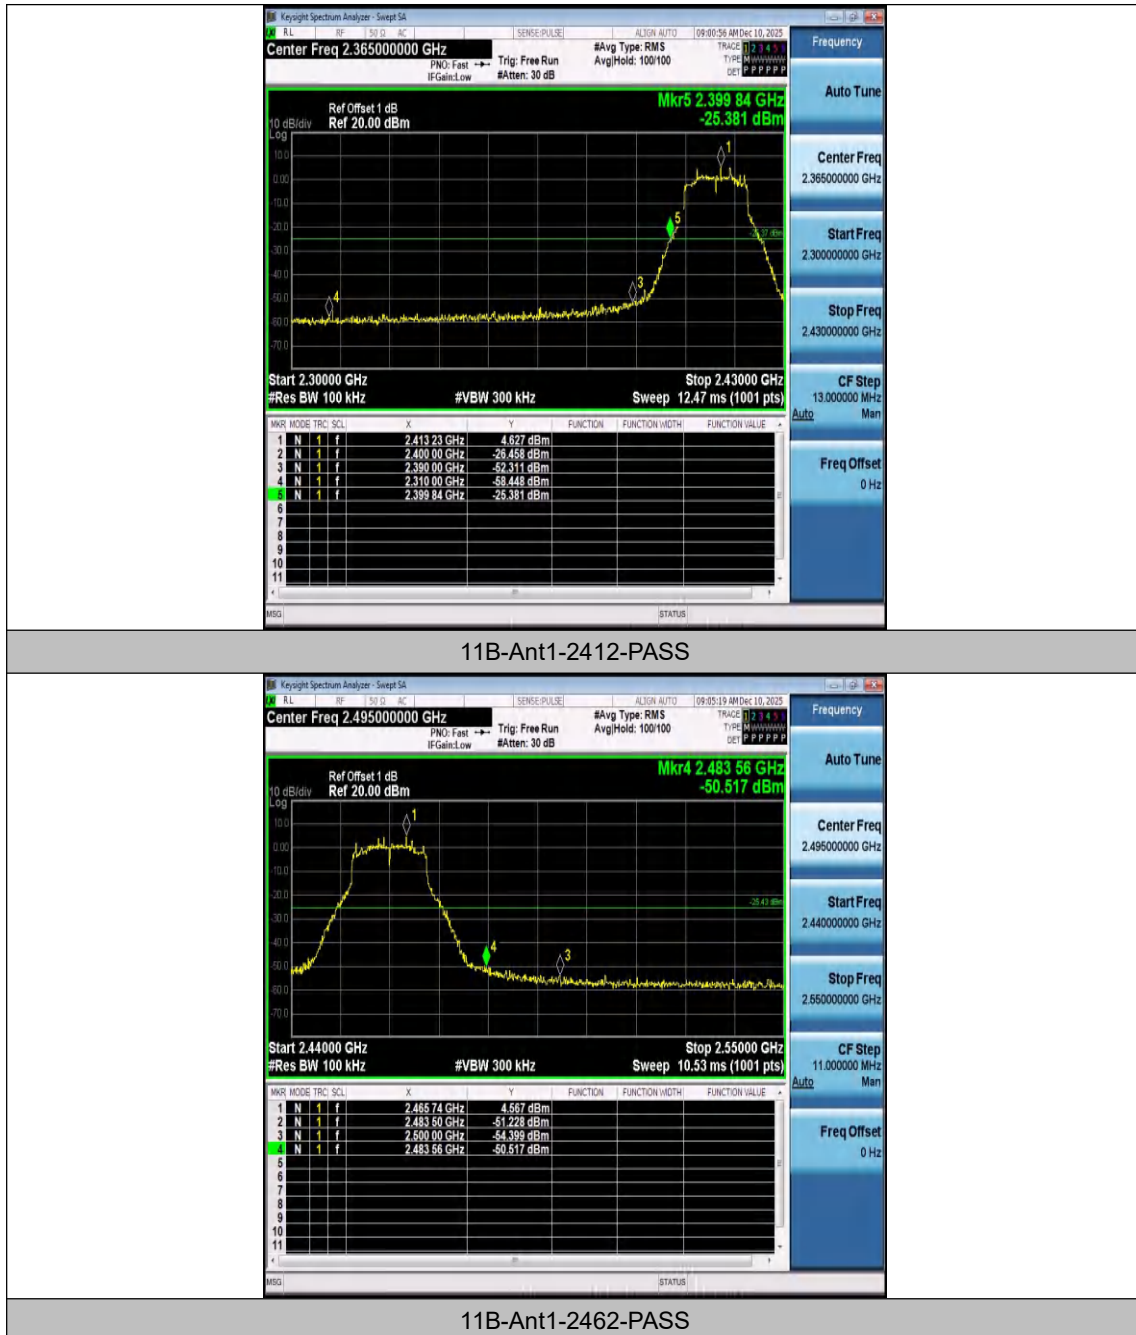

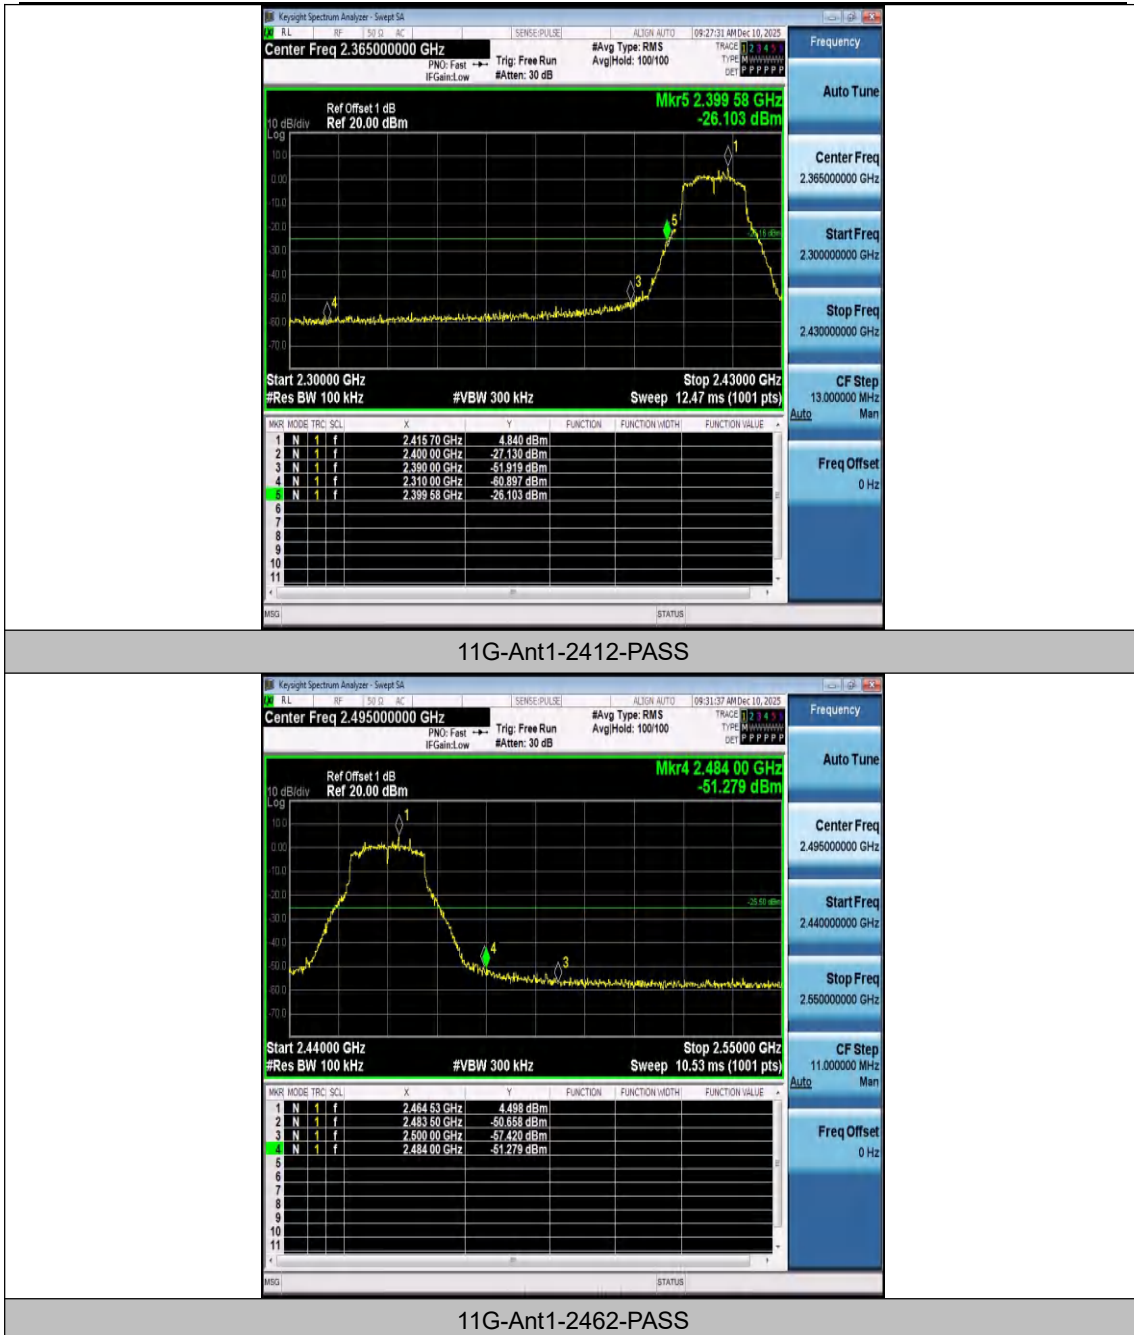

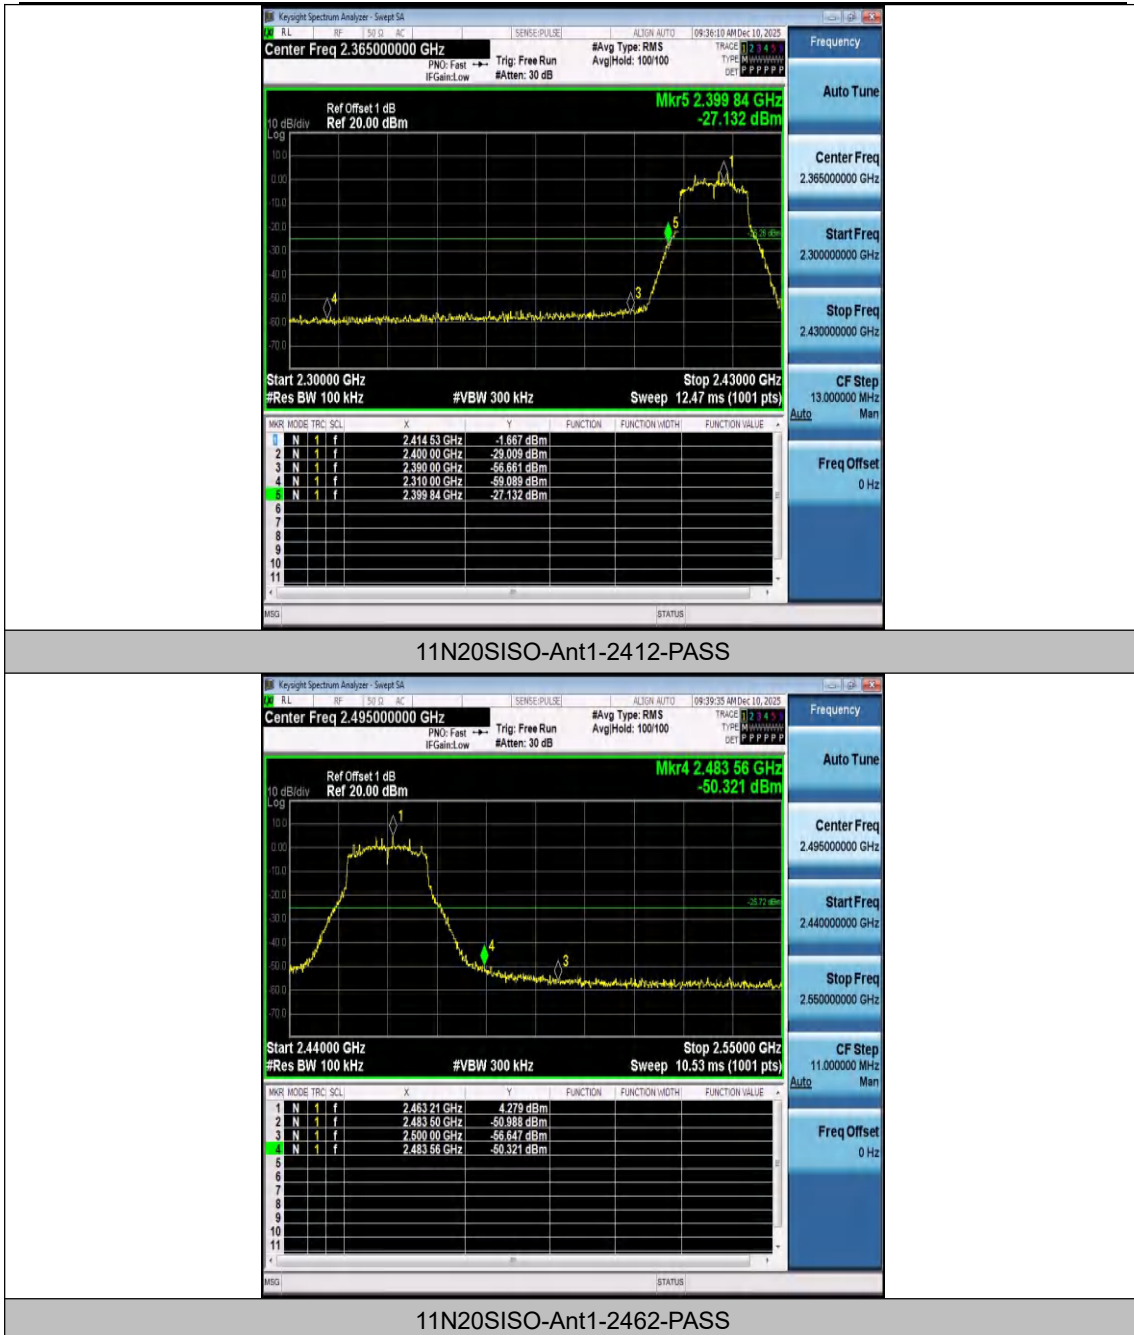

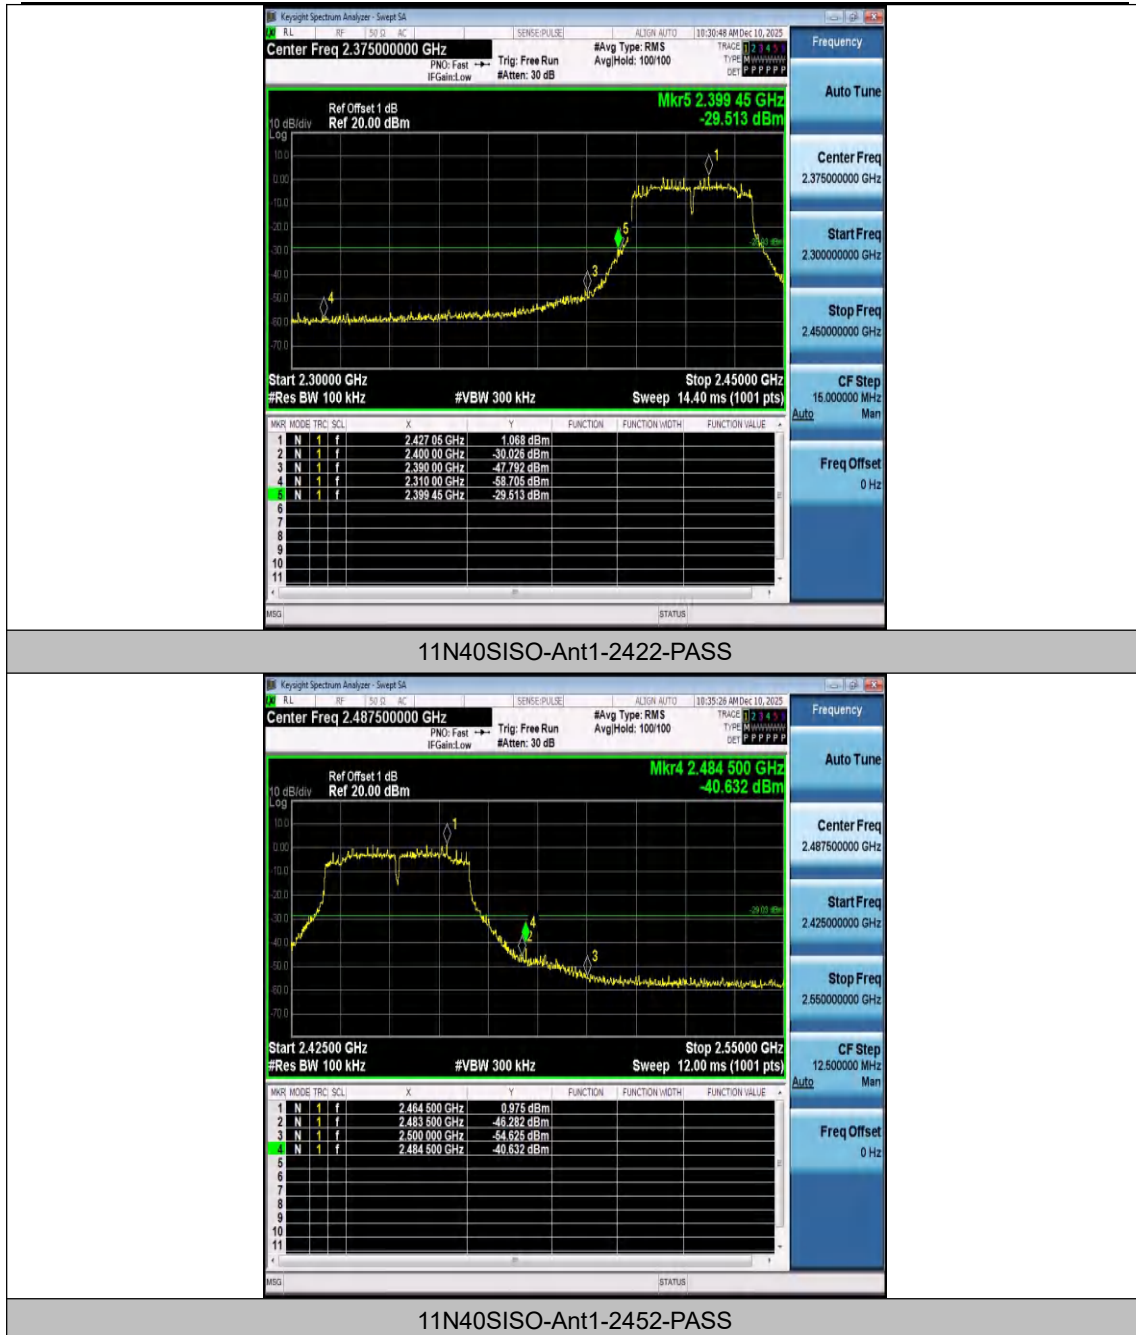

## Appendix F: Conducted Spurious Emission

### Test Result

| Test Mode | Antenna | Frequency [MHz] | Freq. Range [Mhz] | Ref. Level [dBm] | Result [dBm] | Limit [dBm] | Verdict |
|-----------|---------|-----------------|-------------------|------------------|--------------|-------------|---------|
| 11B       | Ant1    | 2412            | 0~Reference       | 3.40             | 3.40         | ---         | PASS    |
| 11B       | Ant1    | 2412            | 30~1000           | 3.40             | -68.06       | ≤-26.6      | PASS    |
| 11B       | Ant1    | 2412            | 1000~26500        | 3.40             | -43.48       | ≤-26.6      | PASS    |
| 11B       | Ant1    | 2437            | 0~Reference       | 3.75             | 3.75         | ---         | PASS    |
| 11B       | Ant1    | 2437            | 30~1000           | 3.75             | -67.97       | ≤-26.25     | PASS    |
| 11B       | Ant1    | 2437            | 1000~26500        | 3.75             | -43.78       | ≤-26.25     | PASS    |
| 11B       | Ant1    | 2462            | 0~Reference       | 3.70             | 3.70         | ---         | PASS    |
| 11B       | Ant1    | 2462            | 30~1000           | 3.70             | -68.22       | ≤-26.3      | PASS    |
| 11B       | Ant1    | 2462            | 1000~26500        | 3.70             | -43.35       | ≤-26.3      | PASS    |
| 11G       | Ant1    | 2412            | 0~Reference       | 1.85             | 1.85         | ---         | PASS    |
| 11G       | Ant1    | 2412            | 30~1000           | 1.85             | -68.68       | ≤-28.15     | PASS    |
| 11G       | Ant1    | 2412            | 1000~26500        | 1.85             | -43.95       | ≤-28.15     | PASS    |
| 11G       | Ant1    | 2437            | 0~Reference       | 3.92             | 3.92         | ---         | PASS    |
| 11G       | Ant1    | 2437            | 30~1000           | 3.92             | -68.29       | ≤-26.08     | PASS    |
| 11G       | Ant1    | 2437            | 1000~26500        | 3.92             | -43.51       | ≤-26.08     | PASS    |
| 11G       | Ant1    | 2462            | 0~Reference       | 4.24             | 4.24         | ---         | PASS    |
| 11G       | Ant1    | 2462            | 30~1000           | 4.24             | -68.62       | ≤-25.76     | PASS    |
| 11G       | Ant1    | 2462            | 1000~26500        | 4.24             | -43.5        | ≤-25.76     | PASS    |
| 11N20SISO | Ant1    | 2412            | 0~Reference       | 4.76             | 4.76         | ---         | PASS    |
| 11N20SISO | Ant1    | 2412            | 30~1000           | 4.76             | -68.42       | ≤-25.24     | PASS    |
| 11N20SISO | Ant1    | 2412            | 1000~26500        | 4.76             | -43.3        | ≤-25.24     | PASS    |
| 11N20SISO | Ant1    | 2437            | 0~Reference       | 0.95             | 0.95         | ---         | PASS    |
| 11N20SISO | Ant1    | 2437            | 30~1000           | 0.95             | -67.98       | ≤-29.05     | PASS    |
| 11N20SISO | Ant1    | 2437            | 1000~26500        | 0.95             | -42.86       | ≤-29.05     | PASS    |
| 11N20SISO | Ant1    | 2462            | 0~Reference       | 2.12             | 2.12         | ---         | PASS    |
| 11N20SISO | Ant1    | 2462            | 30~1000           | 2.12             | -67.89       | ≤-27.88     | PASS    |
| 11N20SISO | Ant1    | 2462            | 1000~26500        | 2.12             | -43.55       | ≤-27.88     | PASS    |
| 11N40SISO | Ant1    | 2422            | 0~Reference       | 0.44             | 0.44         | ---         | PASS    |
| 11N40SISO | Ant1    | 2422            | 30~1000           | 0.44             | -68.15       | ≤-29.56     | PASS    |
| 11N40SISO | Ant1    | 2422            | 1000~26500        | 0.44             | -43.59       | ≤-29.56     | PASS    |
| 11N40SISO | Ant1    | 2437            | 0~Reference       | -0.39            | -0.39        | ---         | PASS    |
| 11N40SISO | Ant1    | 2437            | 30~1000           | -0.39            | -68.07       | ≤-30.39     | PASS    |
| 11N40SISO | Ant1    | 2437            | 1000~26500        | -0.39            | -43.89       | ≤-30.39     | PASS    |
| 11N40SISO | Ant1    | 2452            | 0~Reference       | -1.32            | -1.32        | ---         | PASS    |
| 11N40SISO | Ant1    | 2452            | 30~1000           | -1.32            | -68.41       | ≤-31.32     | PASS    |
| 11N40SISO | Ant1    | 2452            | 1000~26500        | -1.32            | -43.62       | ≤-31.32     | PASS    |


Remark: Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'Input Correction' of the Spectrum Analyzer during the test.

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Test Graphs

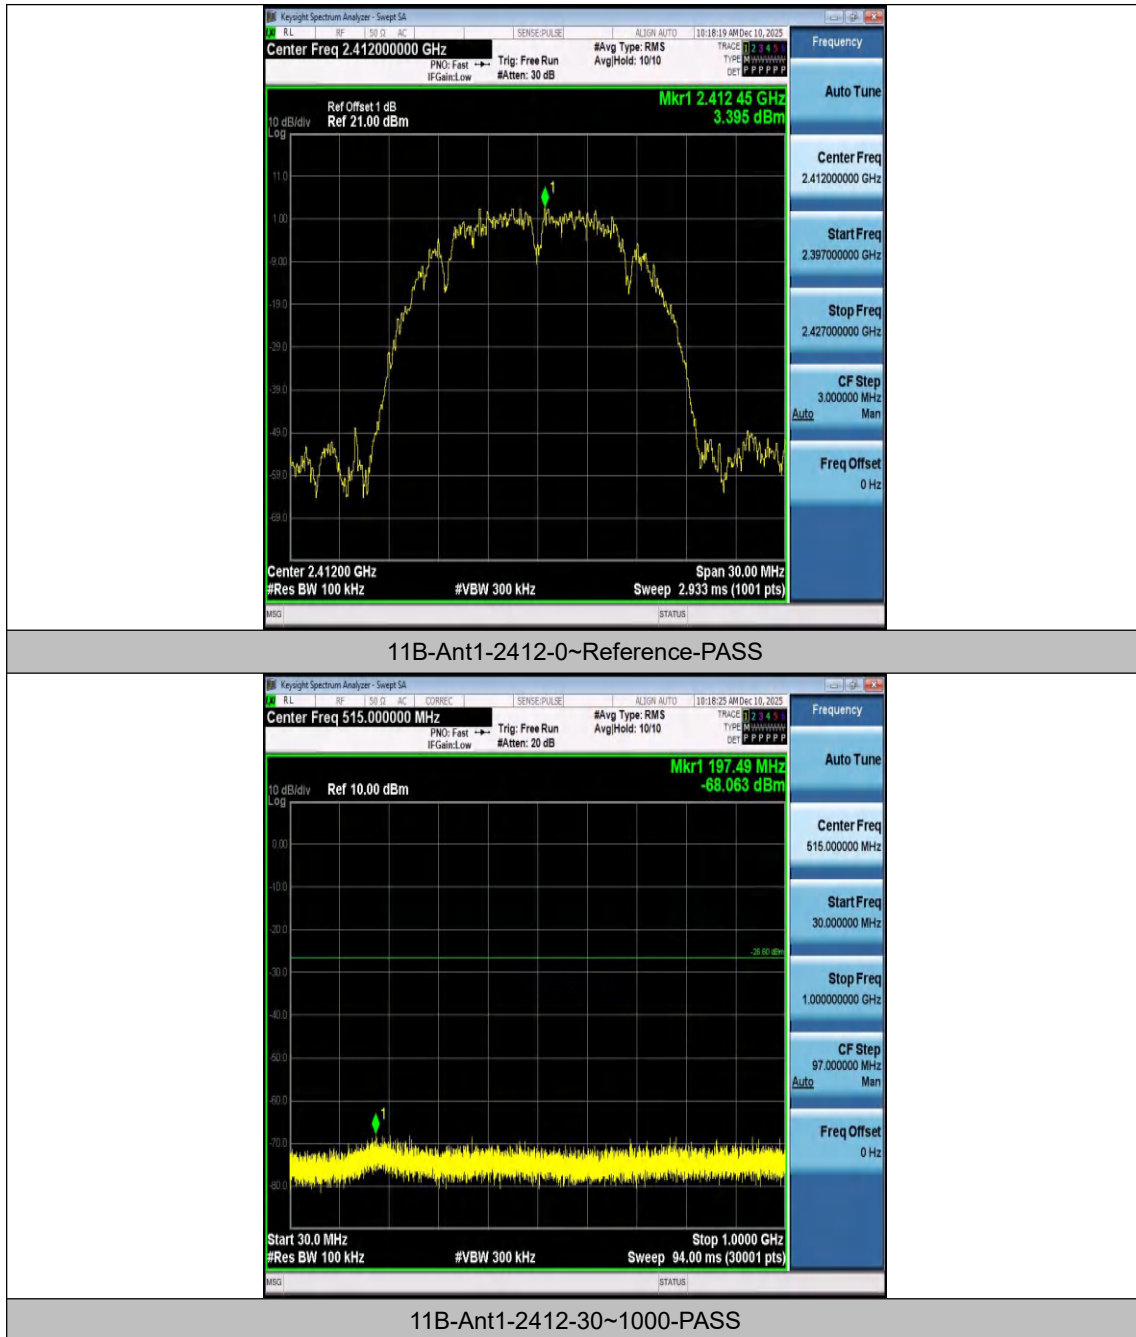

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

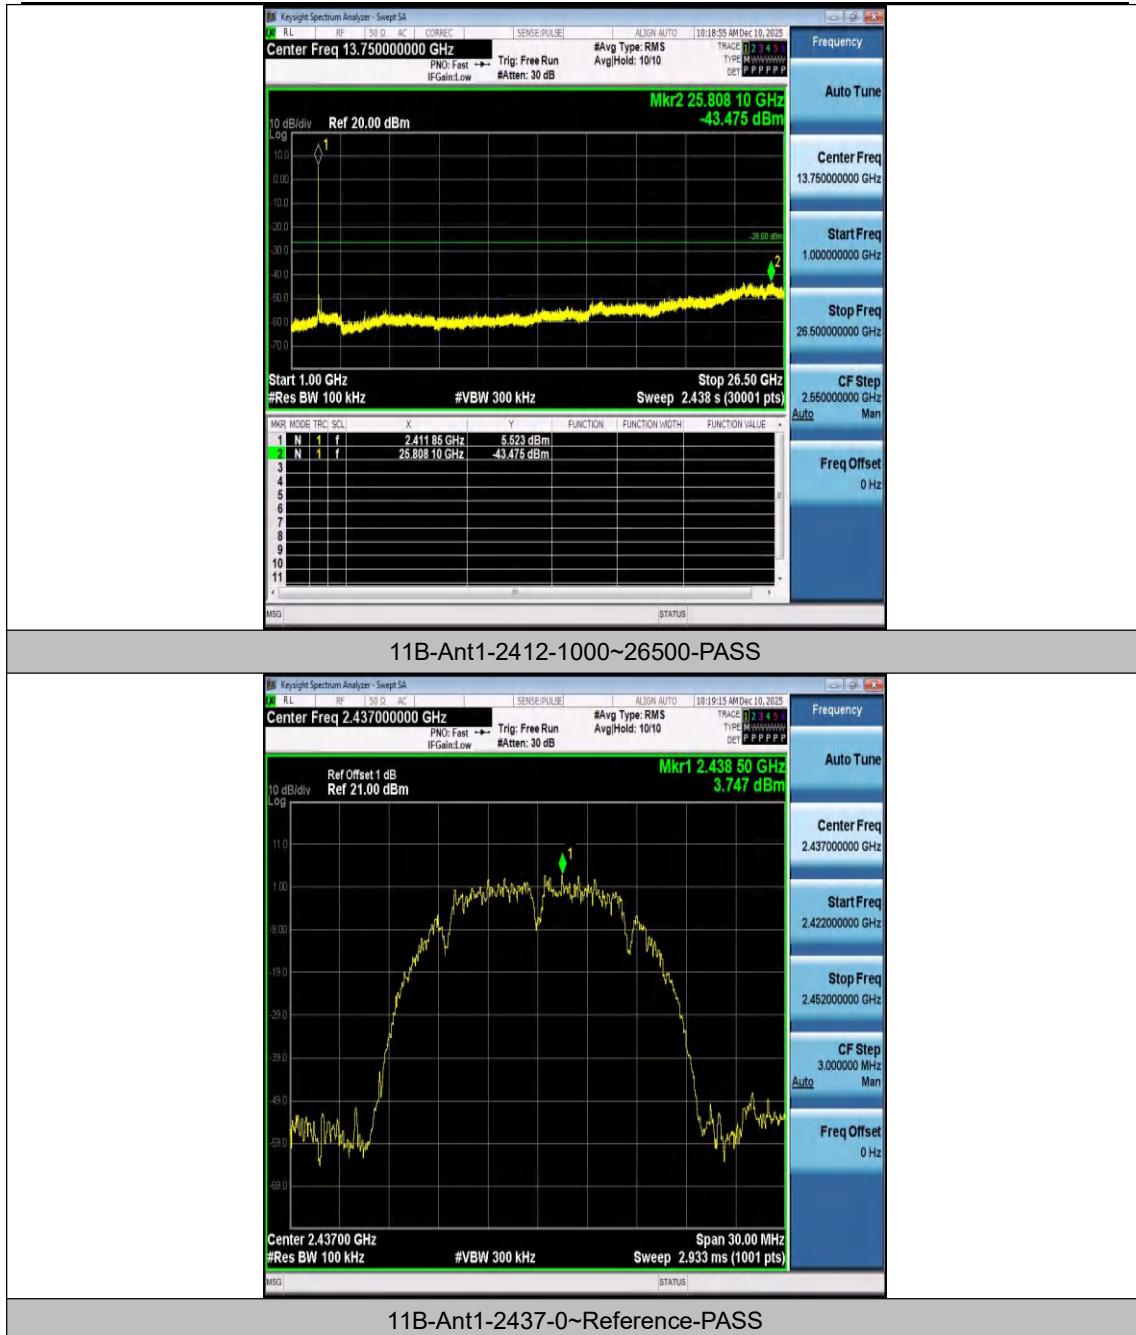

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

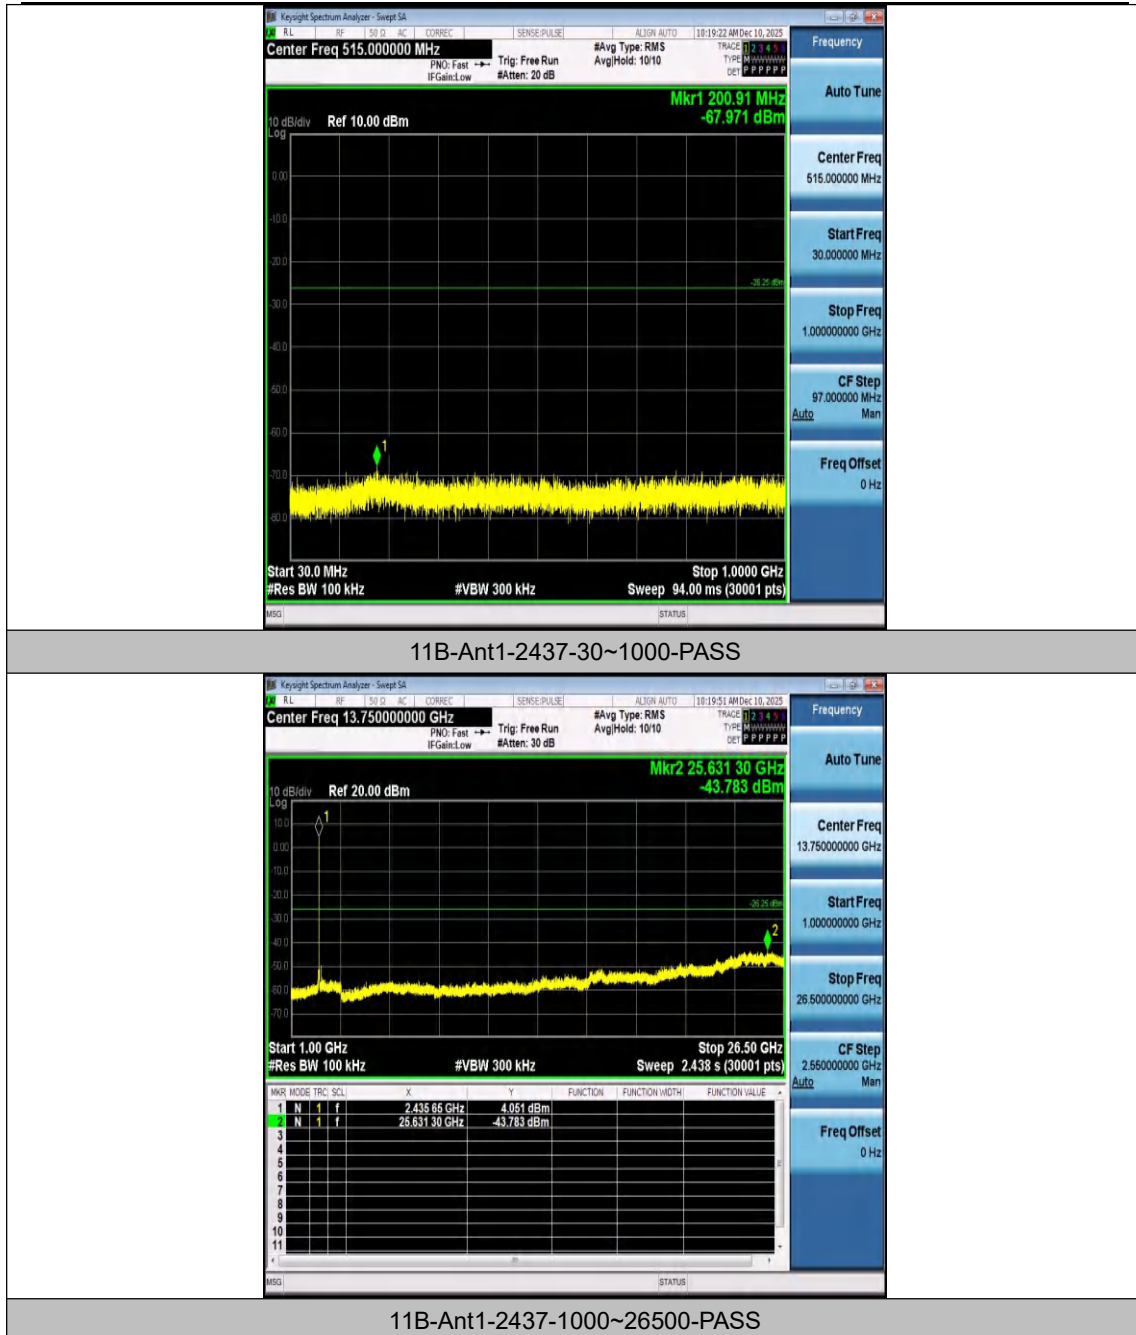

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

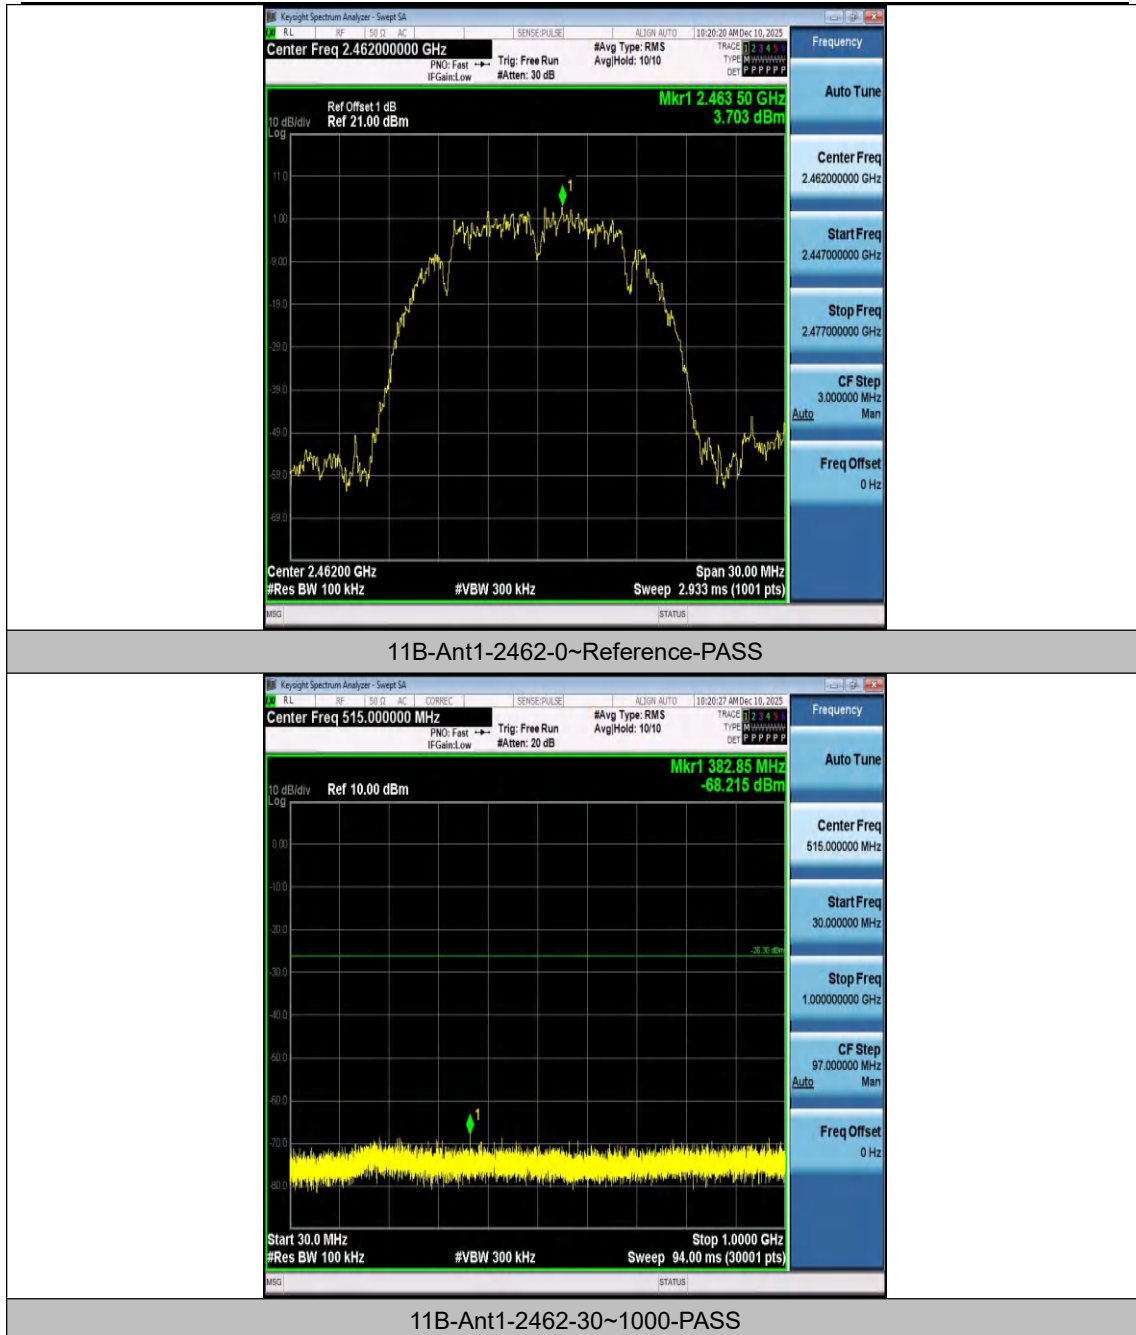

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

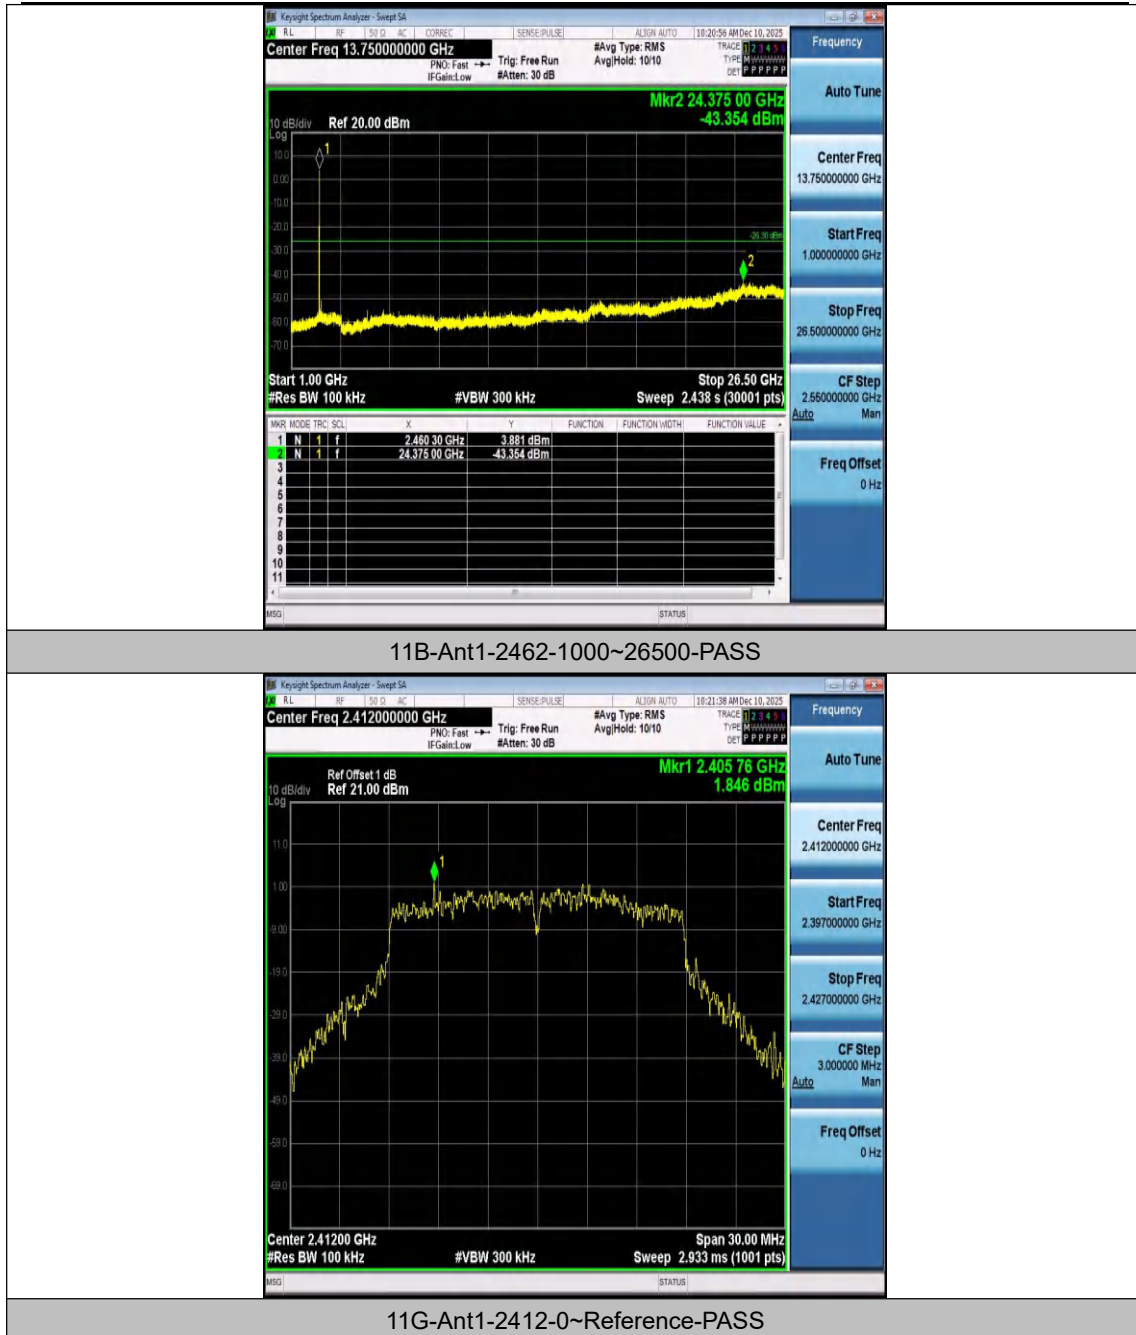

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

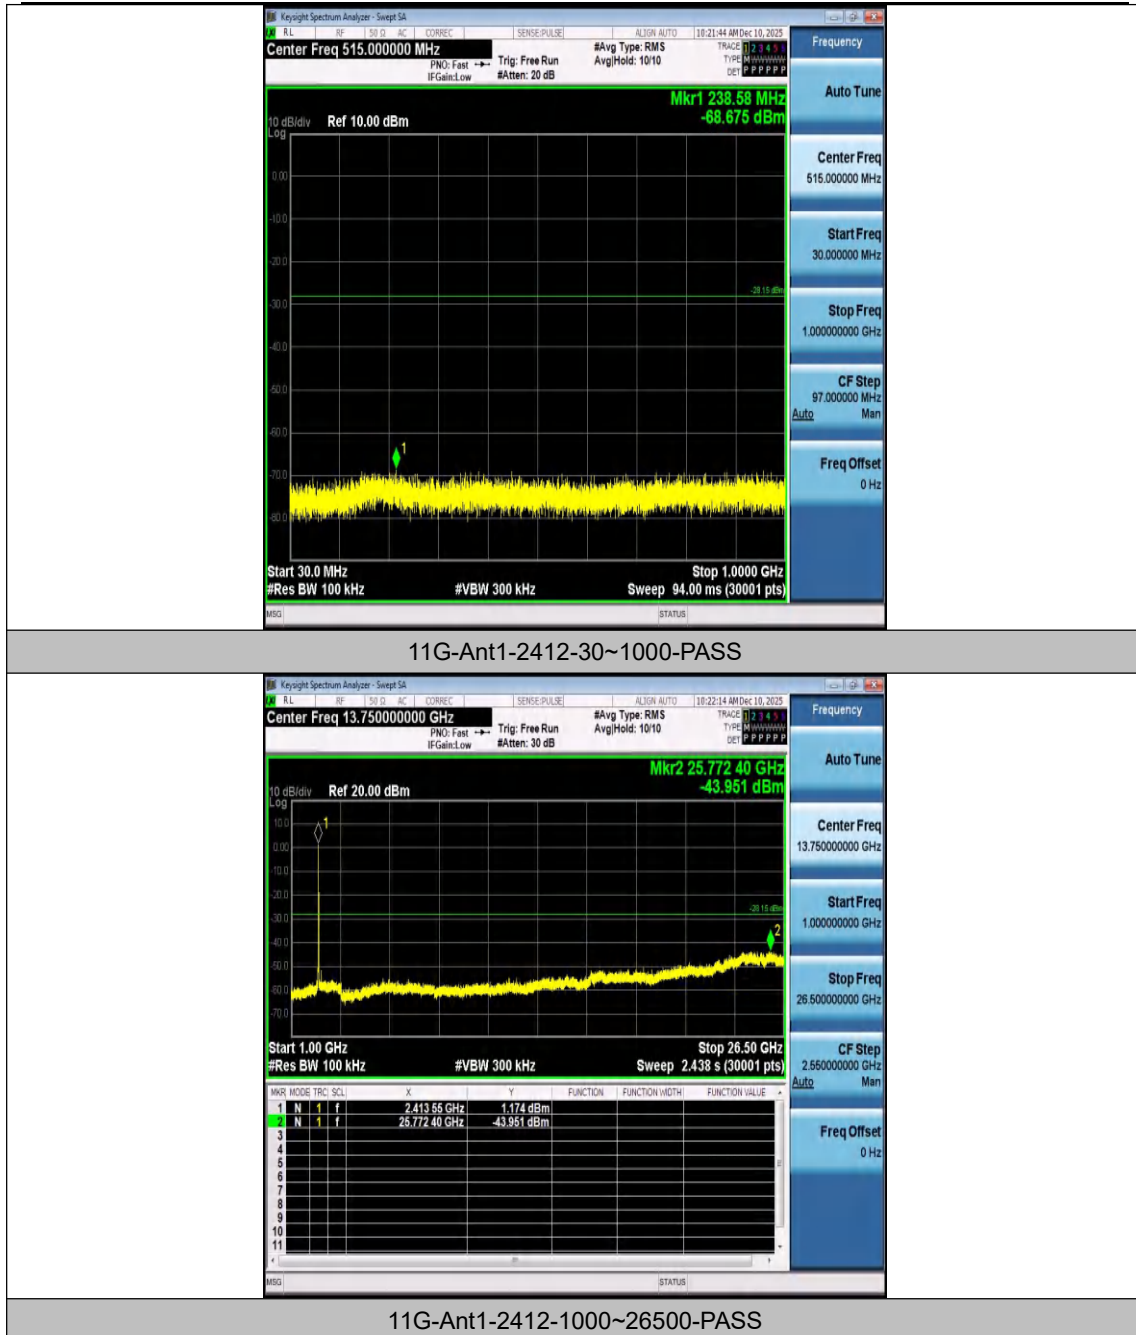

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

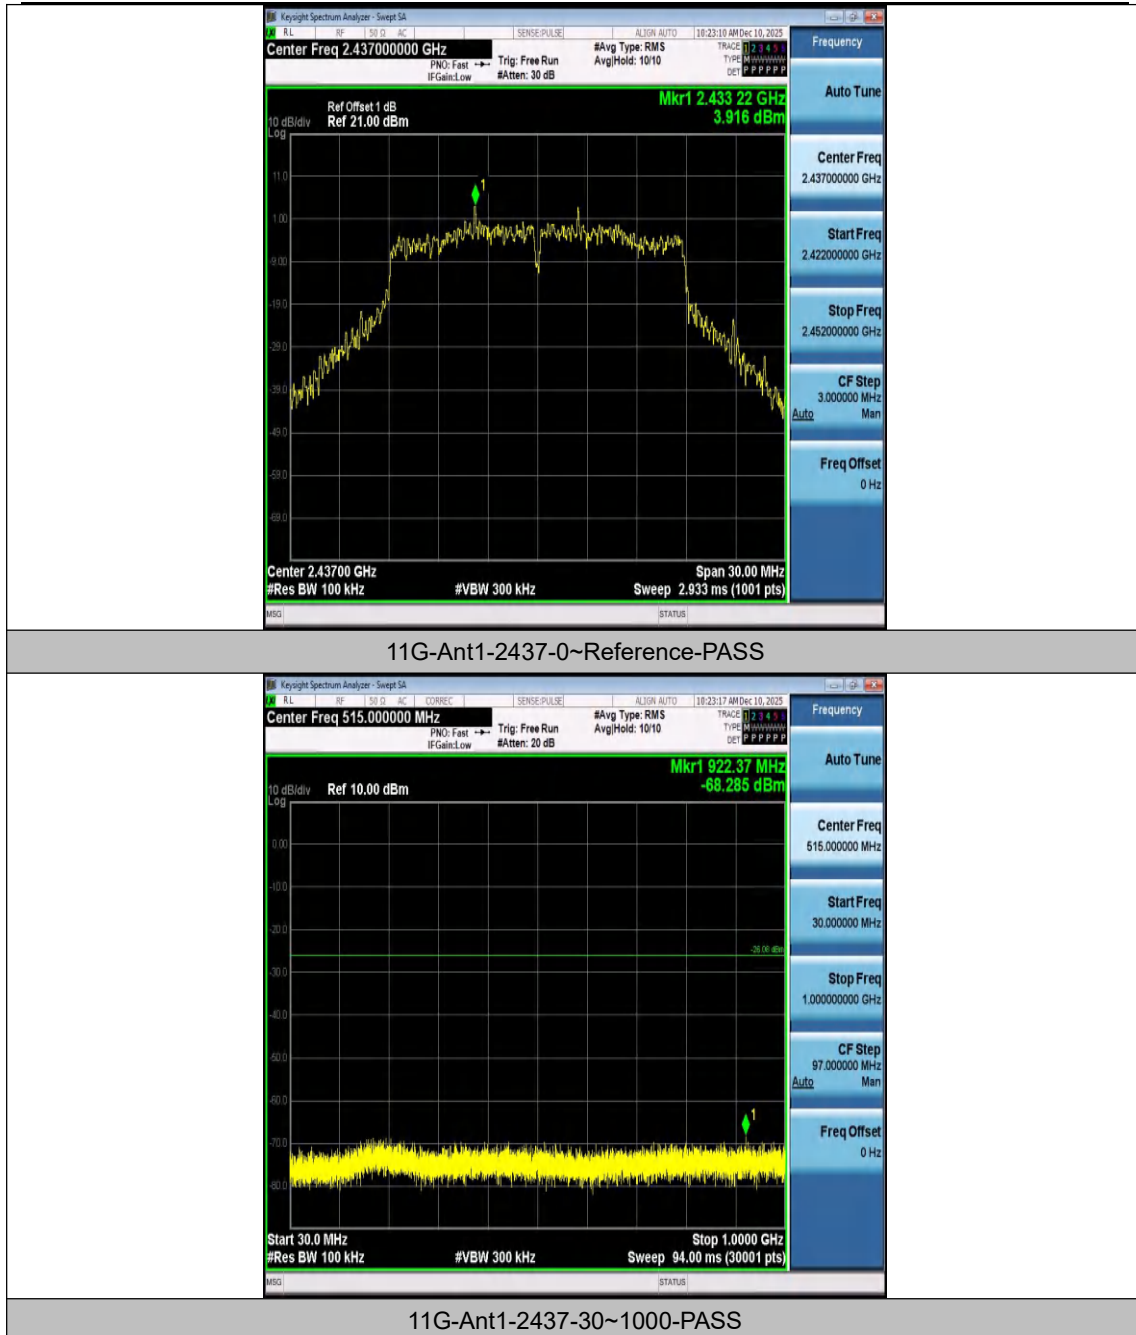


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

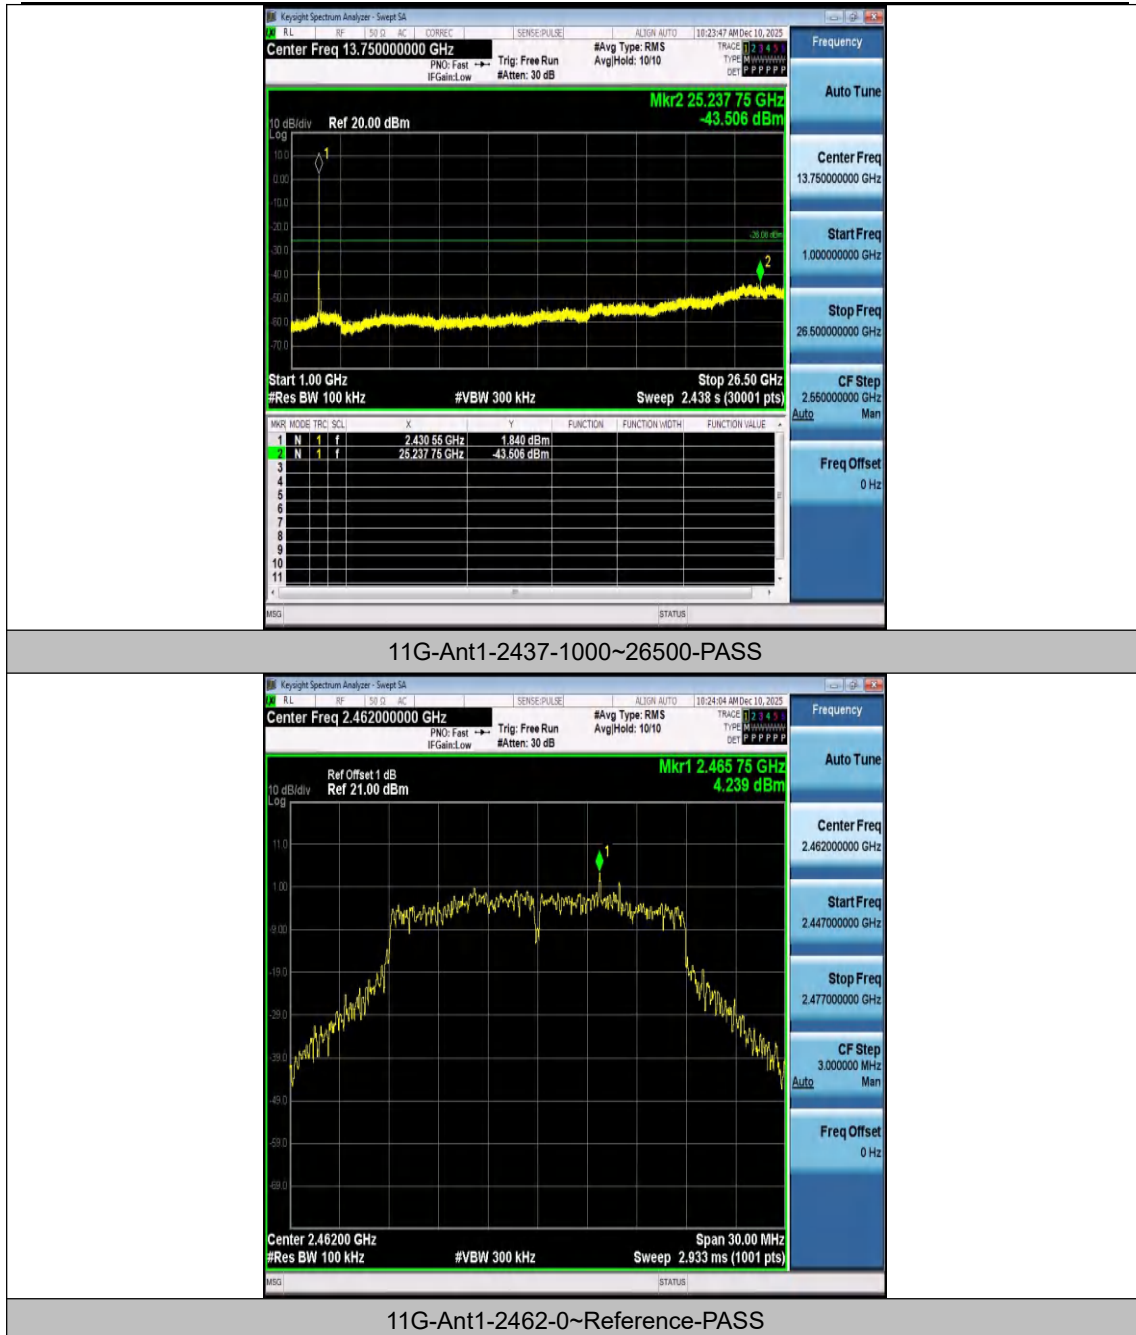


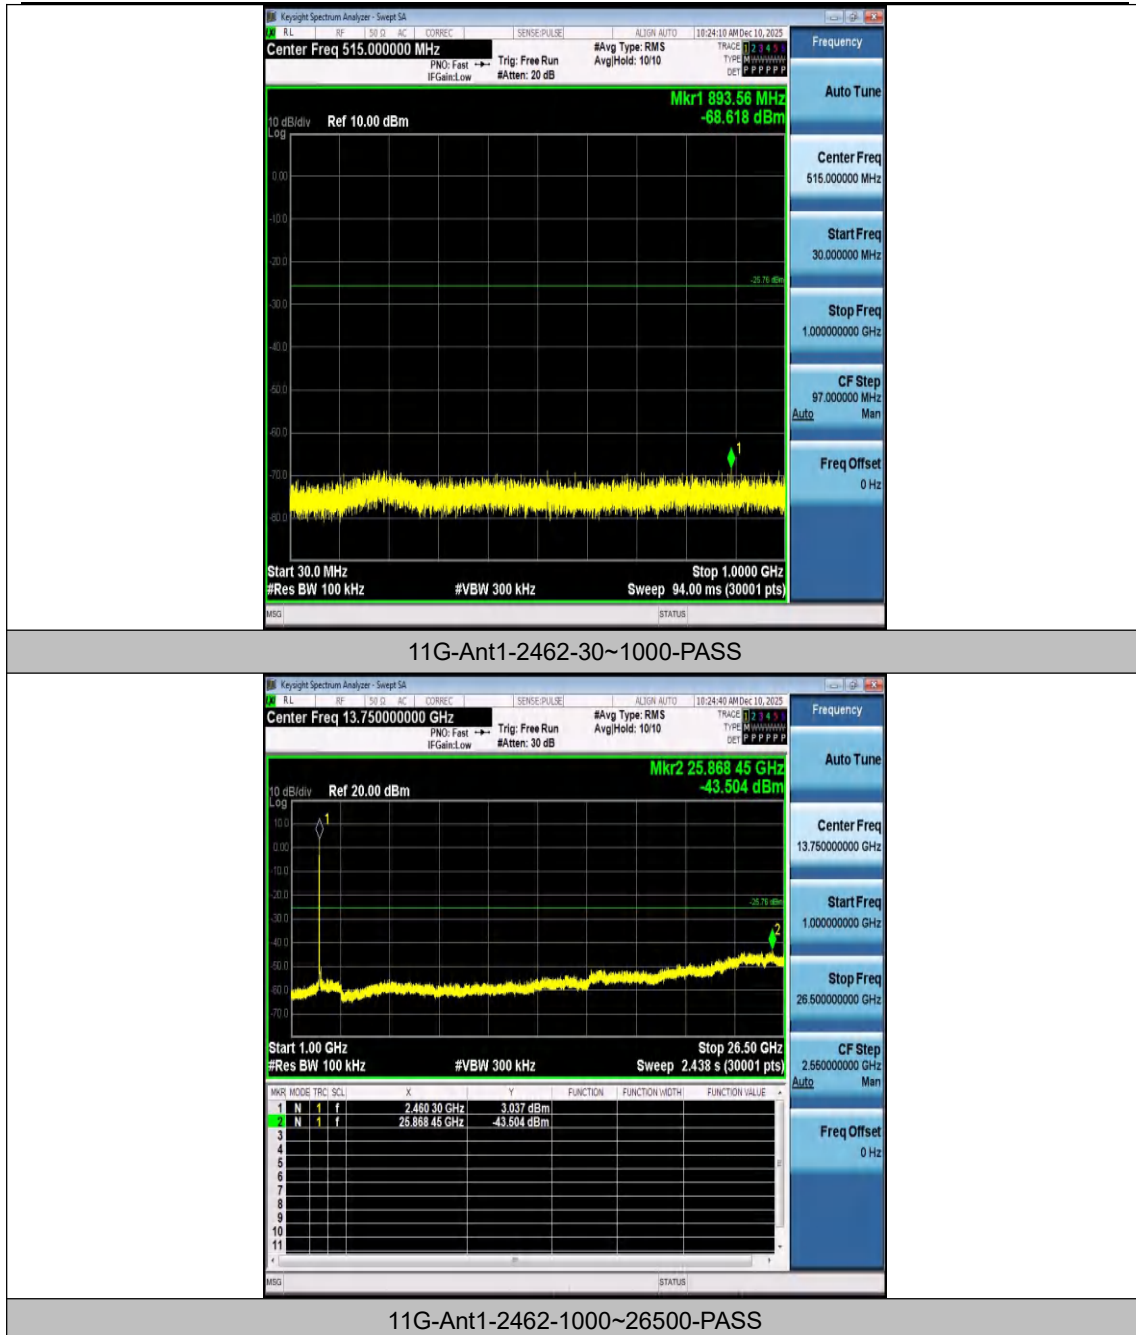

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

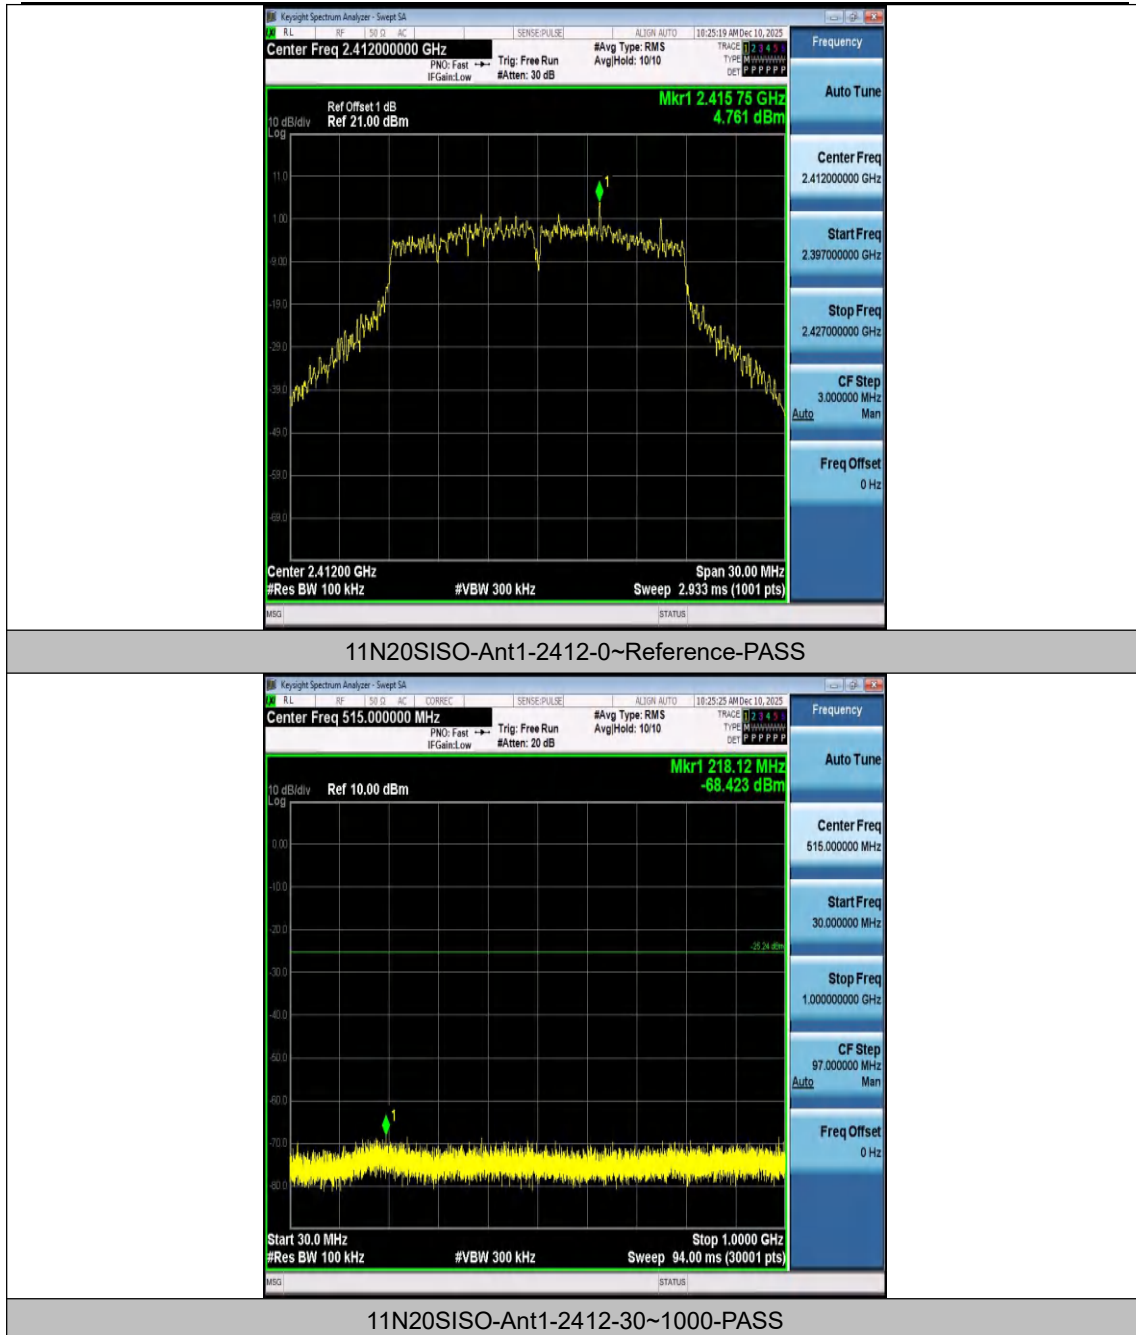


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

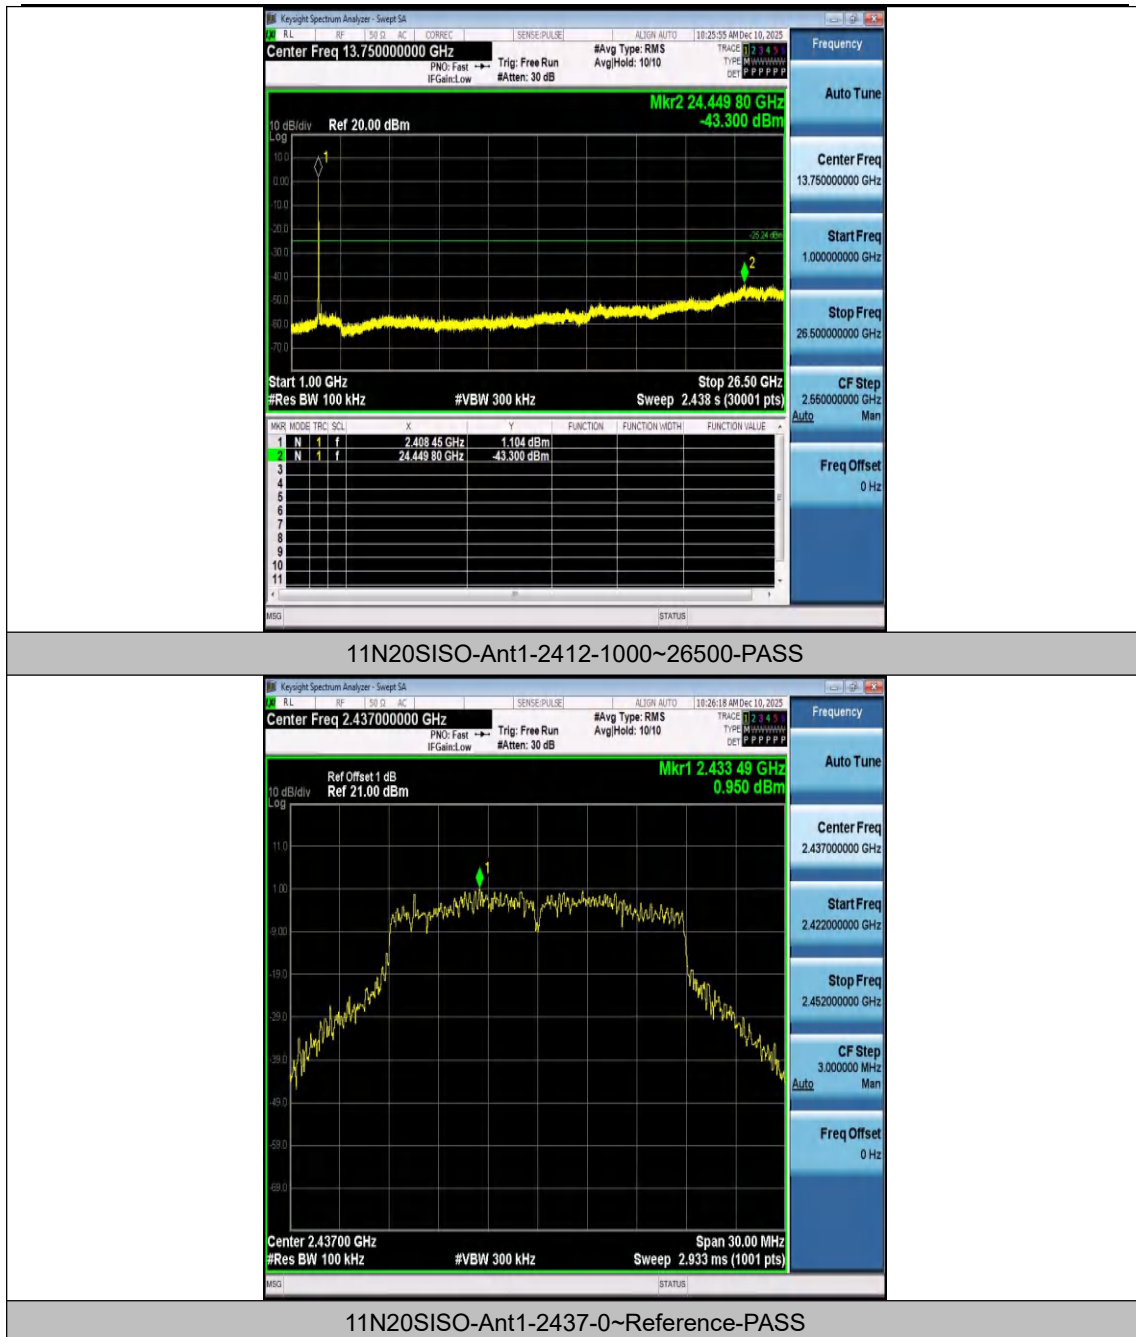


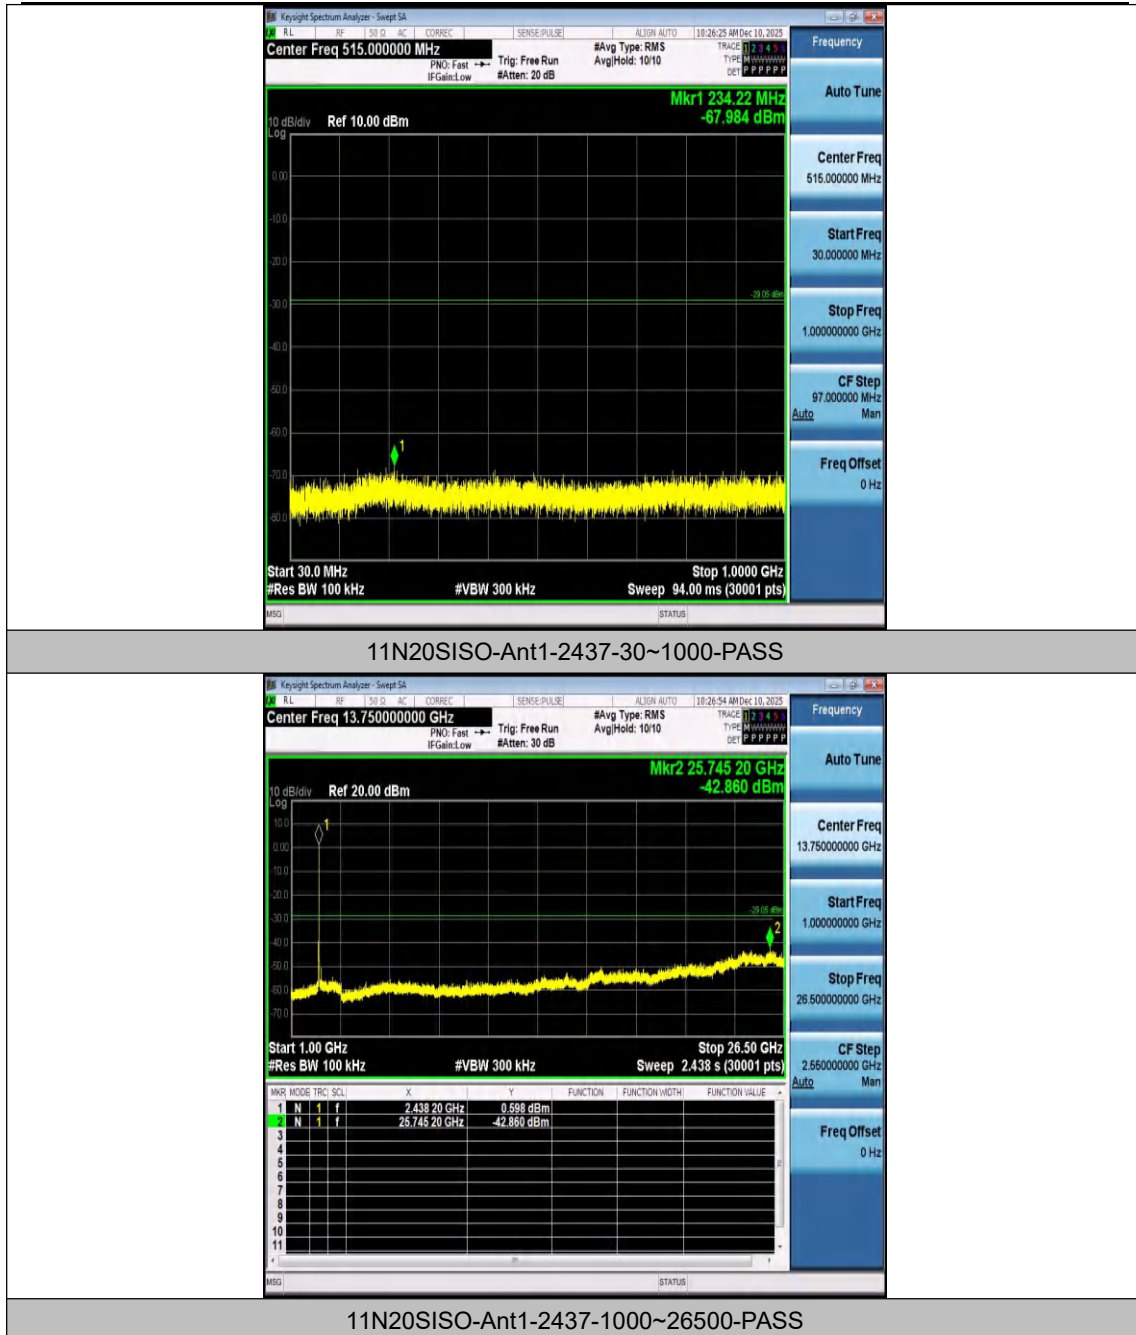

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

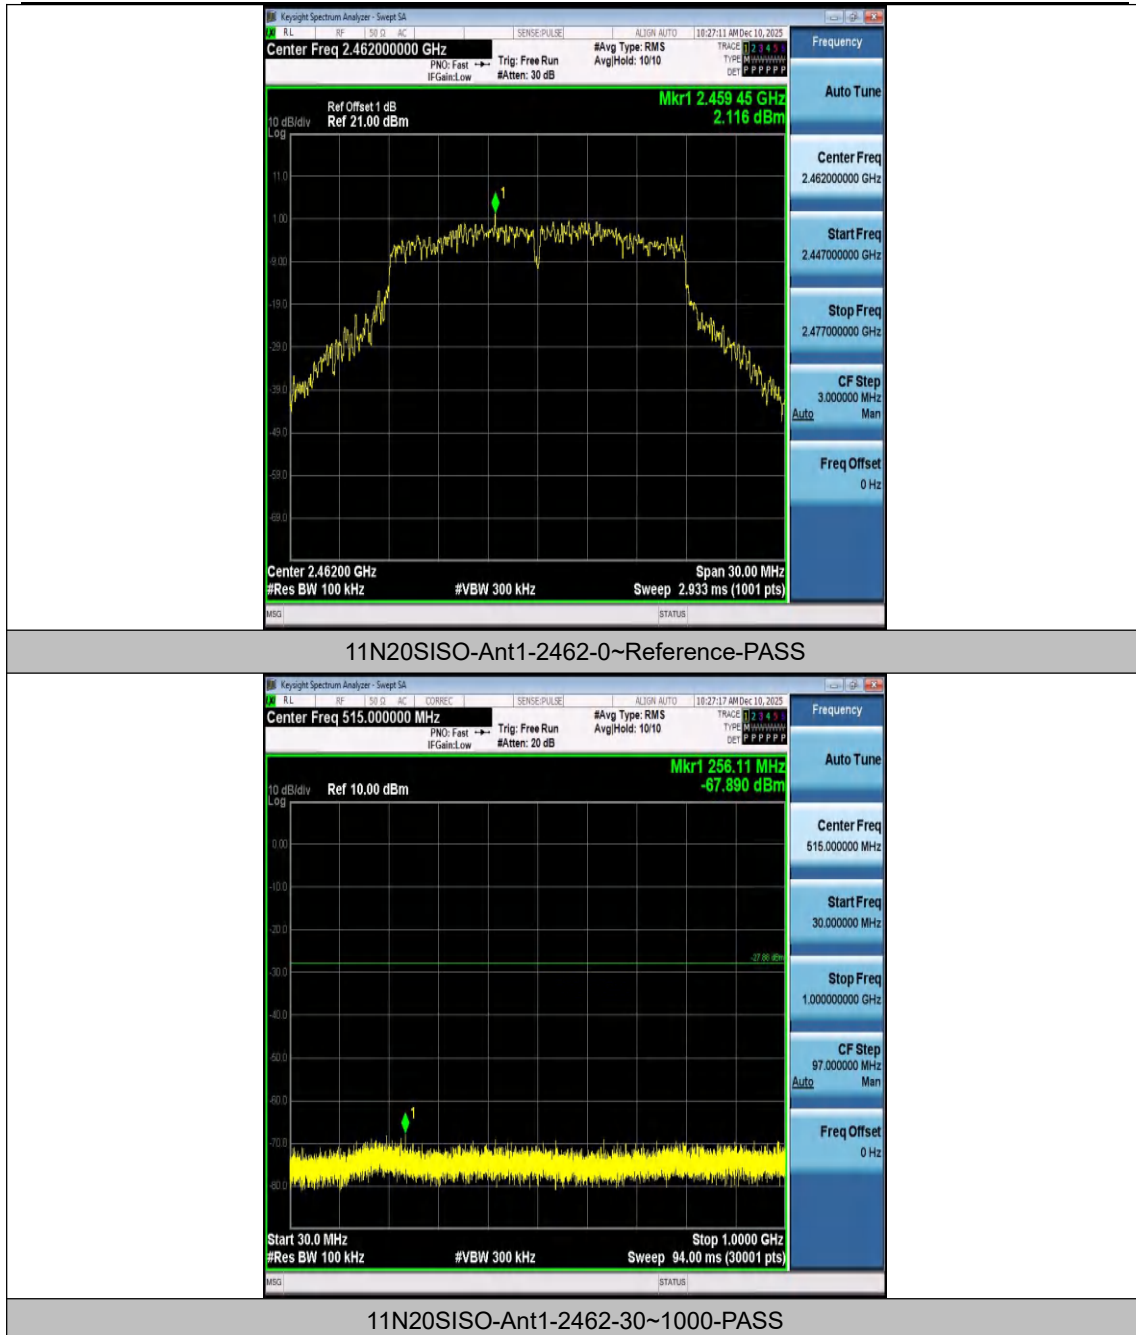

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

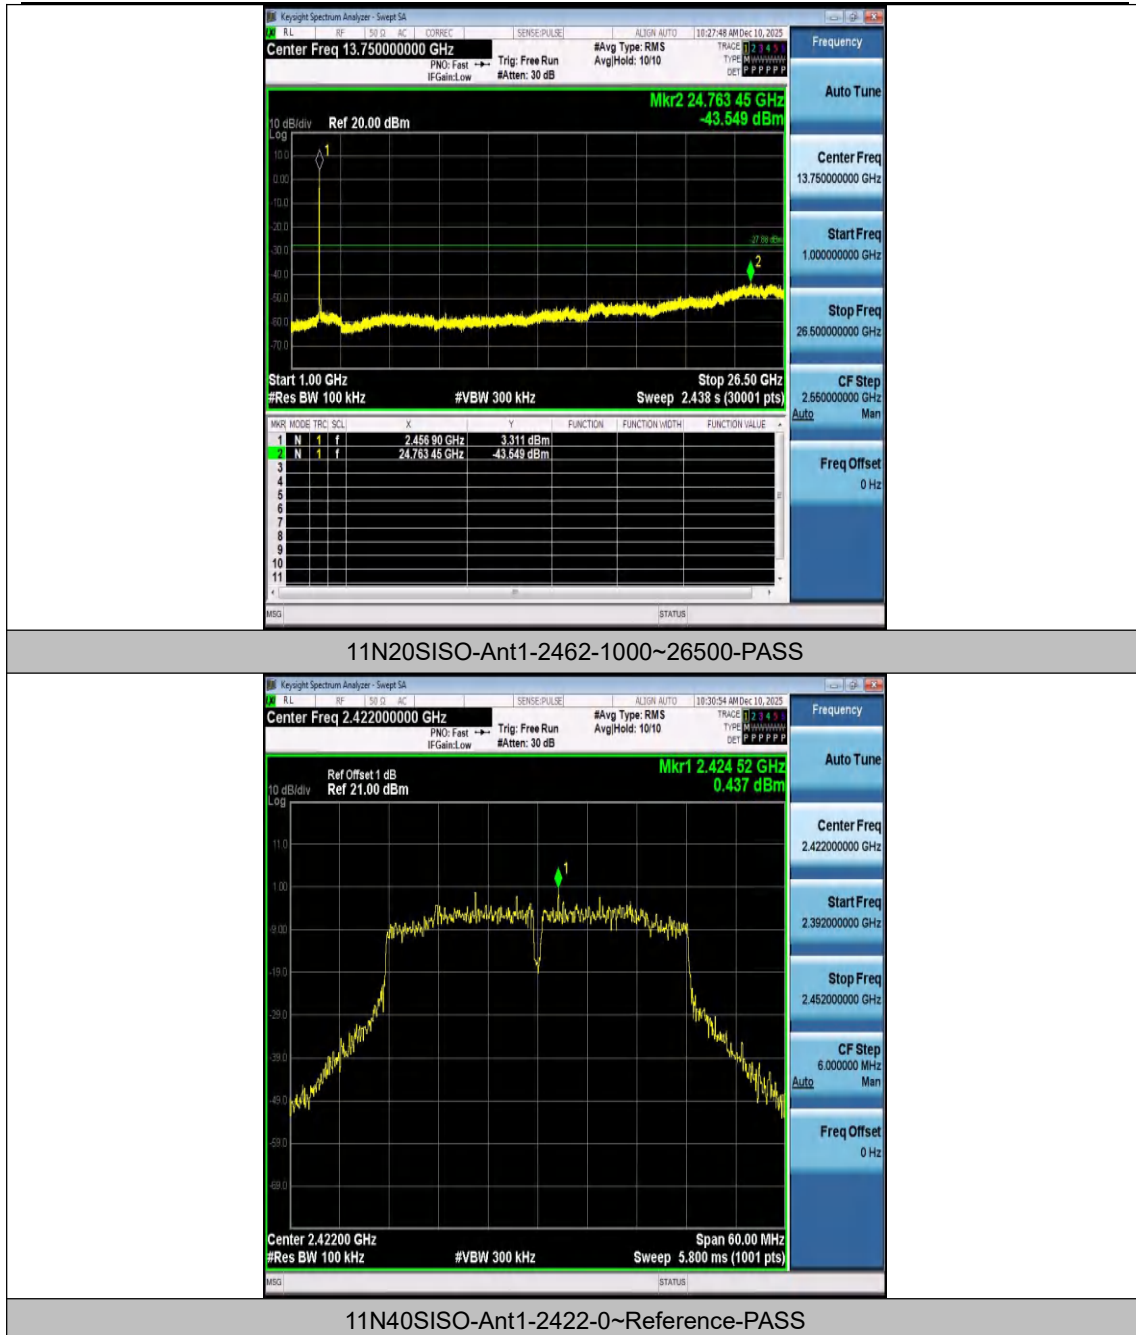

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

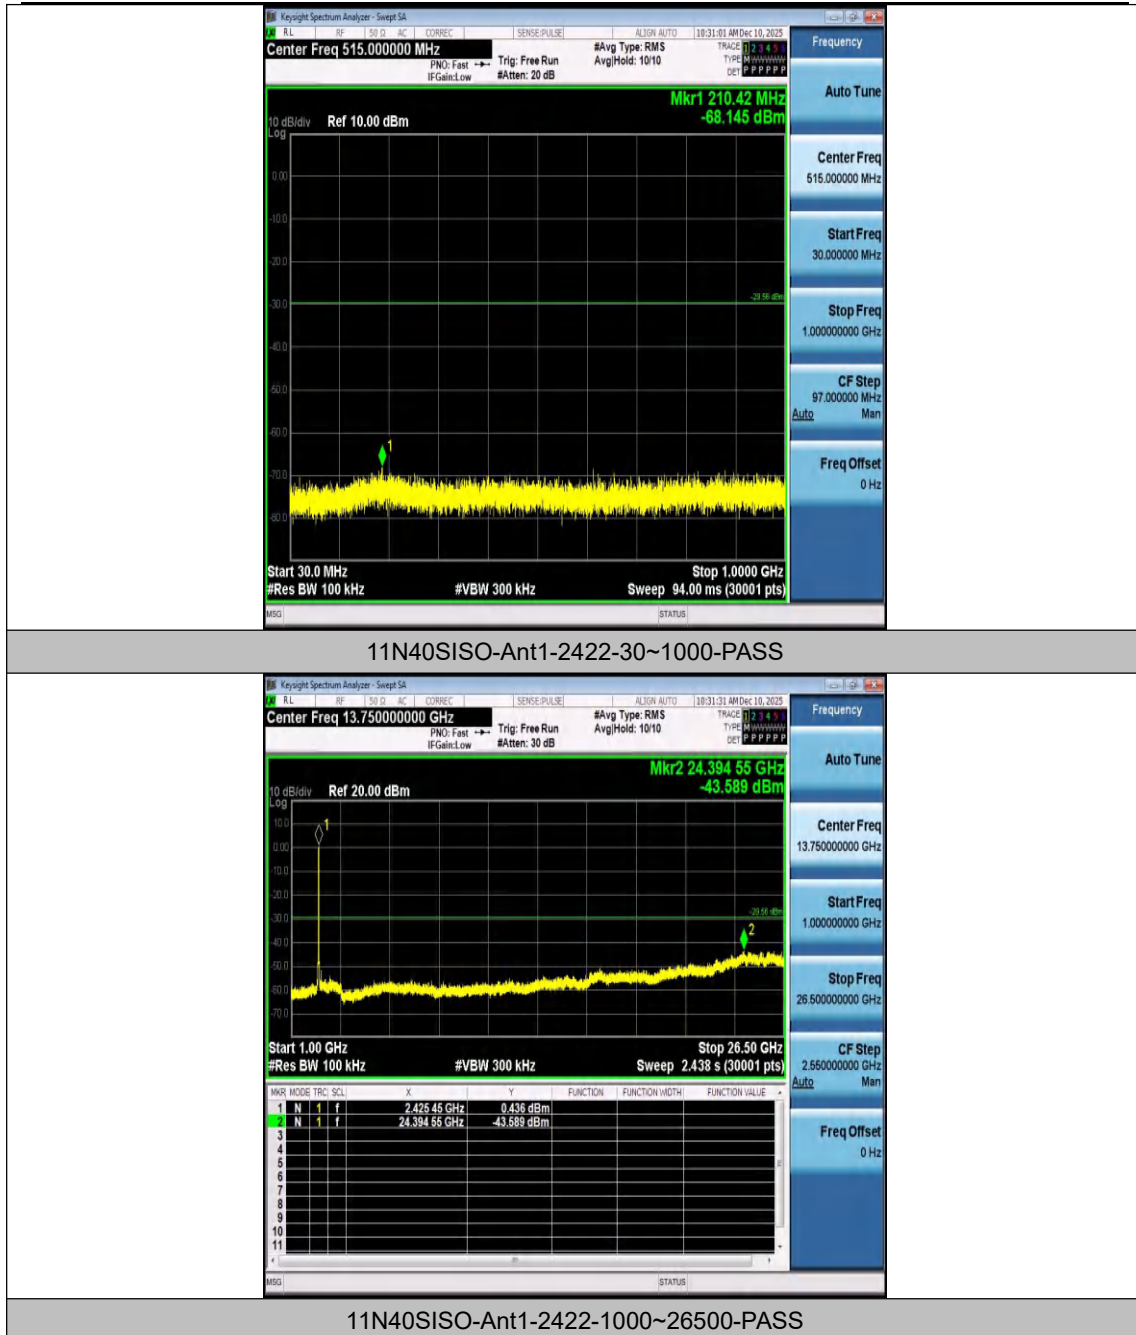

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

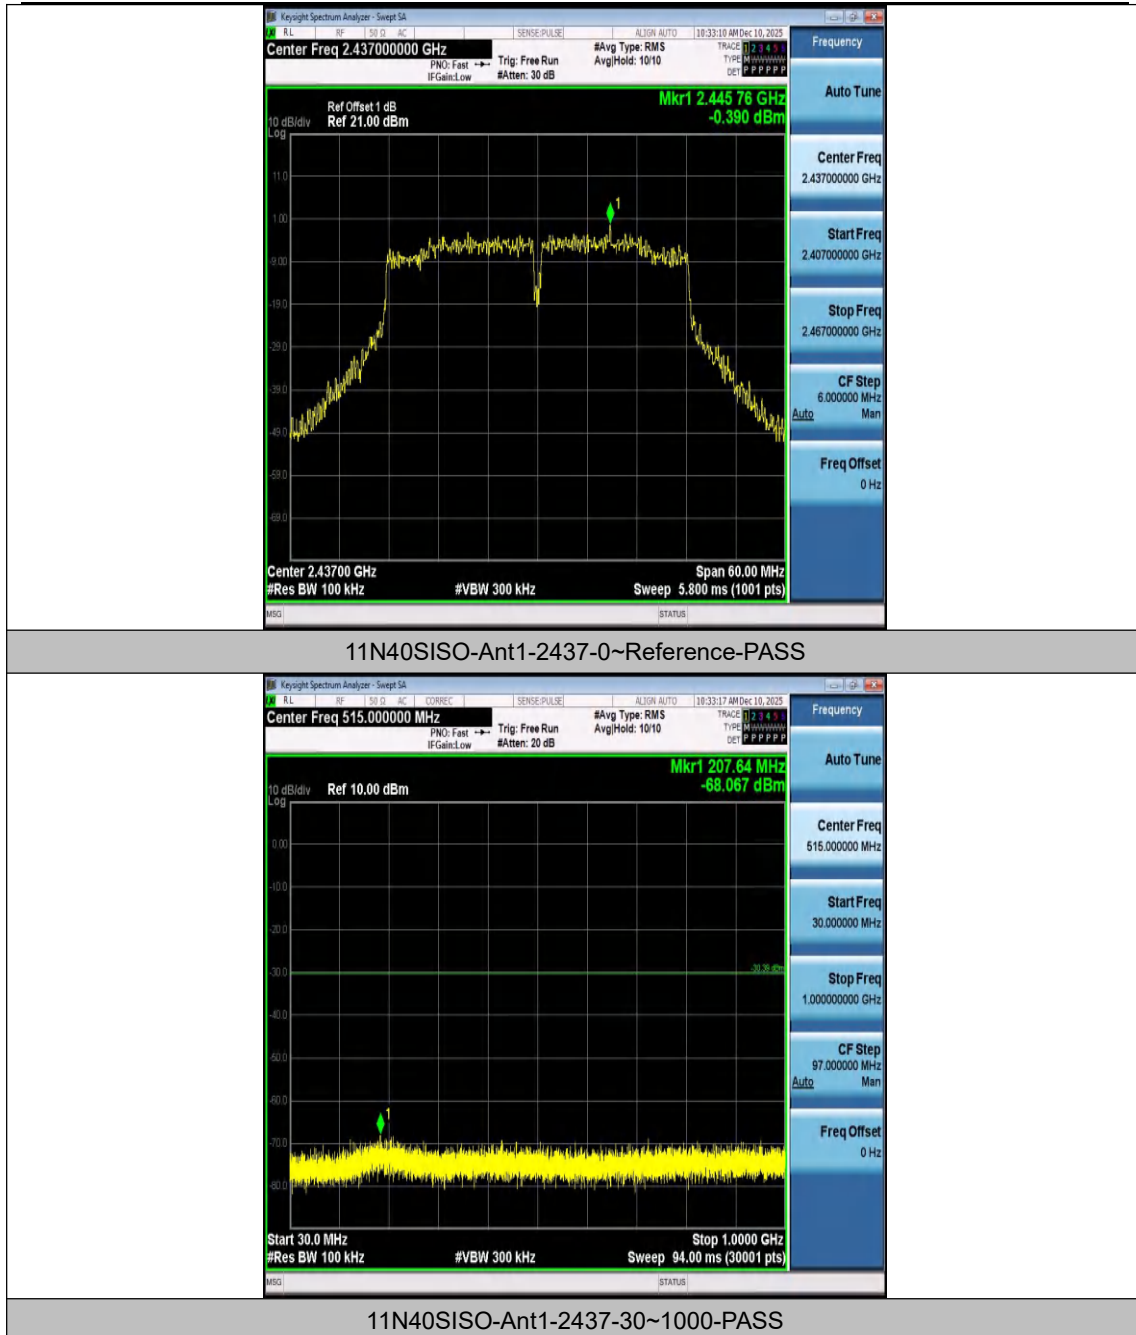

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

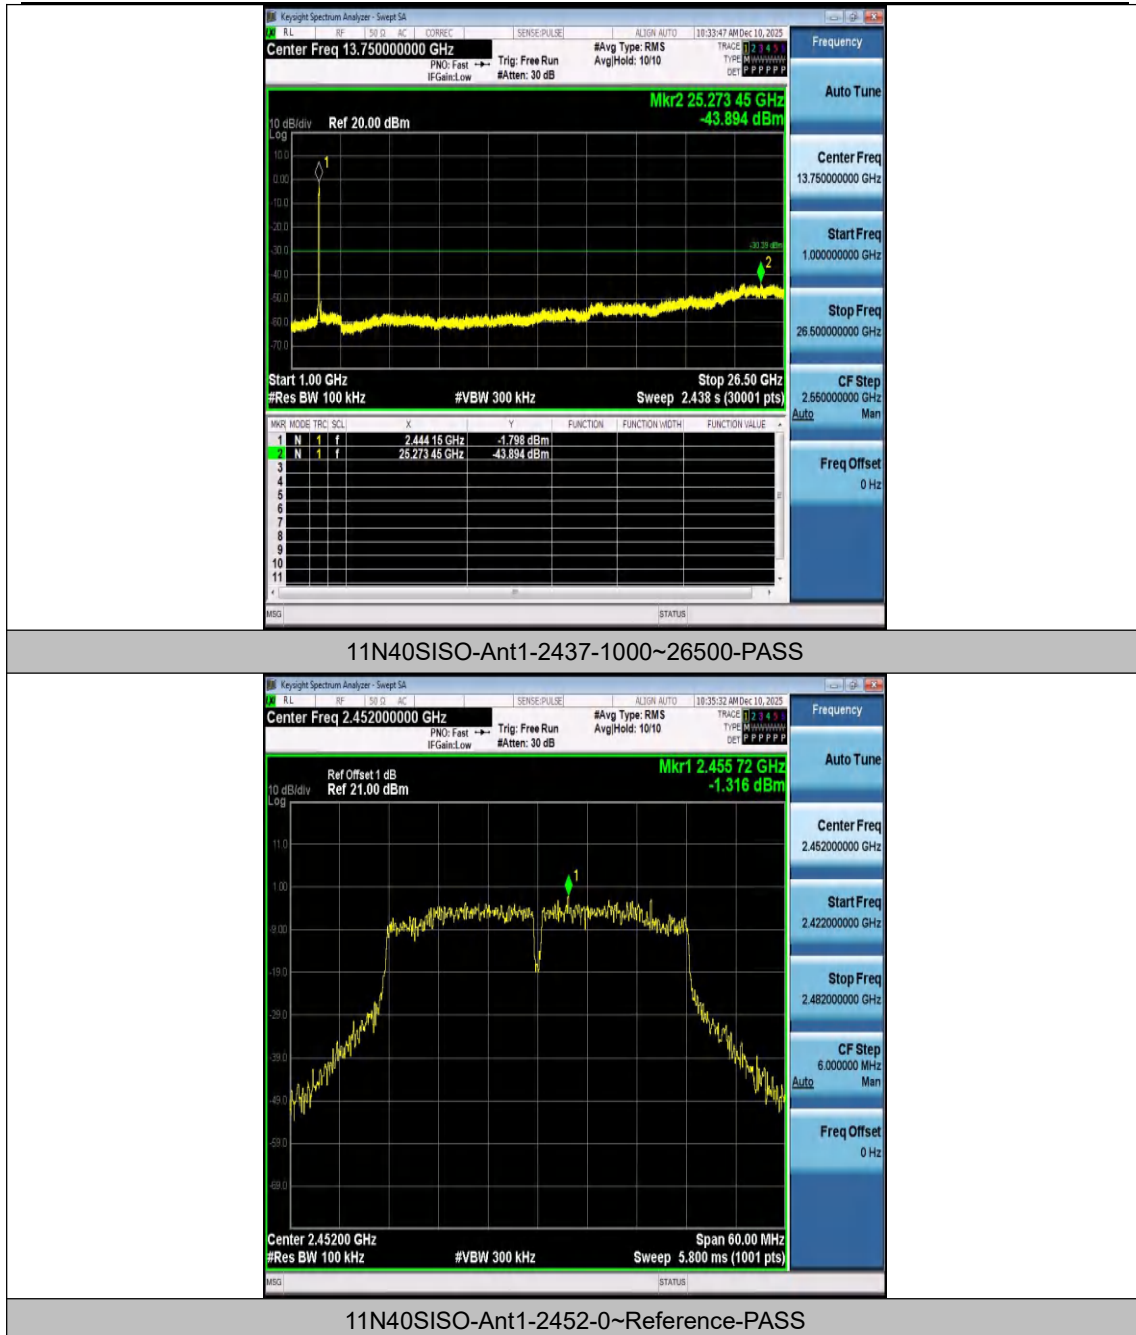

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

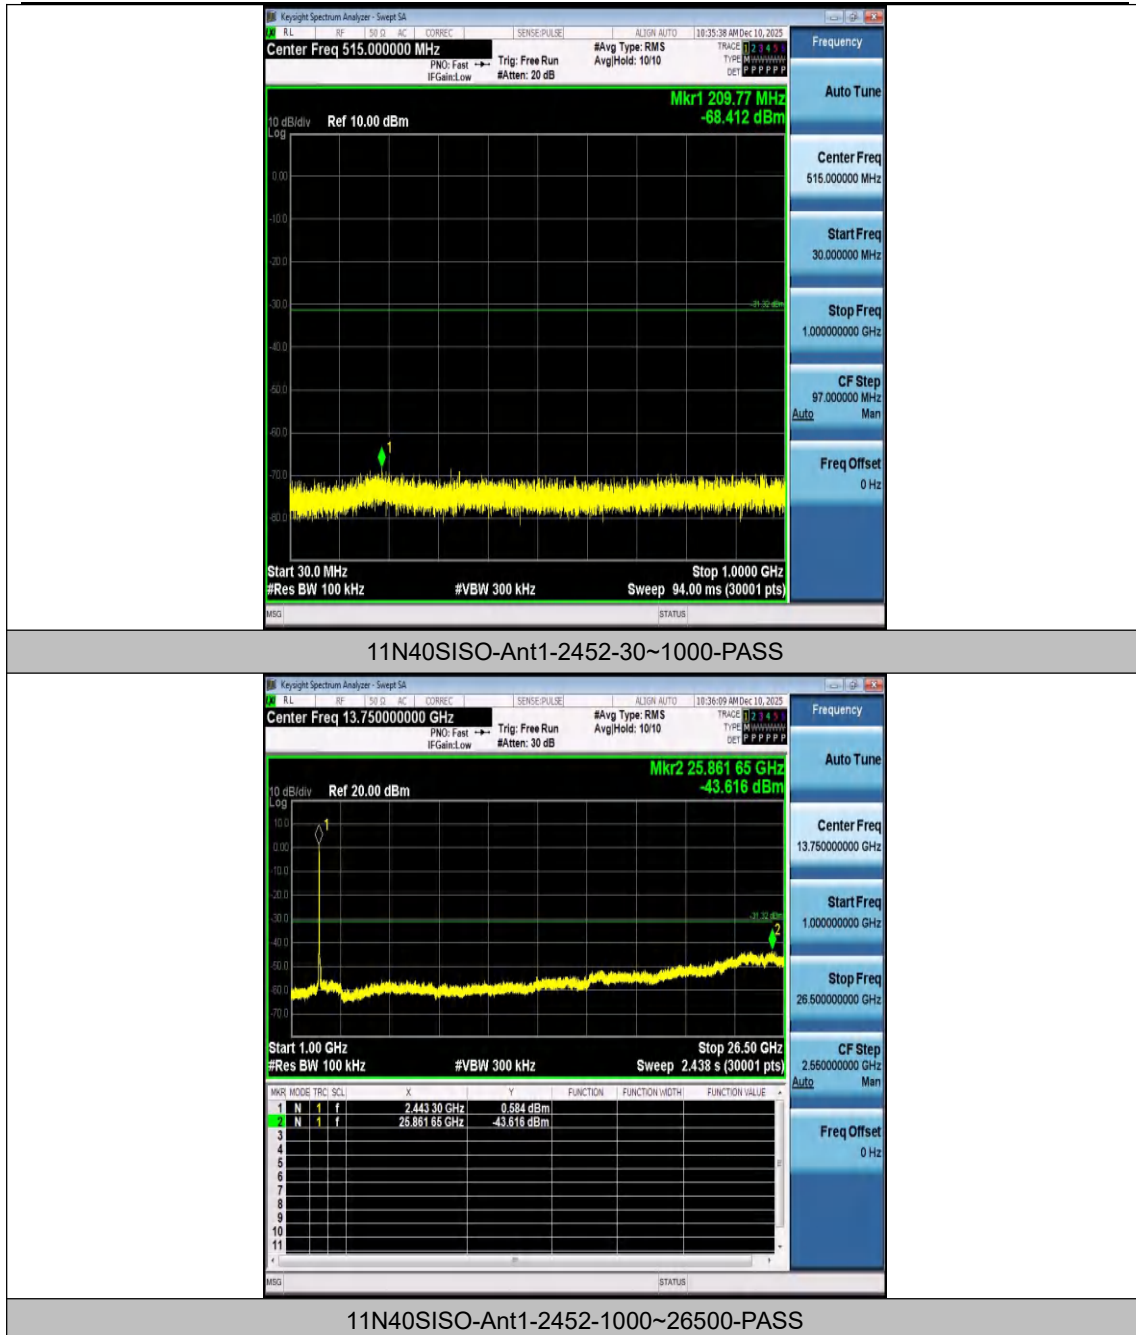

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix G: Duty Cycle

### Test Result

| Test Mode | Antenna | Frequency[MHz] | Transmission Duration [ms] | Transmission Period [ms] | Duty Cycle [%] | Factor |
|-----------|---------|----------------|----------------------------|--------------------------|----------------|--------|
| 11B       | Ant1    | 2412           | 100.00                     | 100.00                   | 100.00         | 0.00   |
| 11B       | Ant1    | 2437           | 100.00                     | 100.00                   | 100.00         | 0.00   |
| 11B       | Ant1    | 2462           | 100.00                     | 100.00                   | 100.00         | 0.00   |
| 11G       | Ant1    | 2412           | 100.00                     | 100.00                   | 100.00         | 0.00   |
| 11G       | Ant1    | 2437           | 100.00                     | 100.00                   | 100.00         | 0.00   |
| 11G       | Ant1    | 2462           | 100.00                     | 100.00                   | 100.00         | 0.00   |
| 11N20SISO | Ant1    | 2412           | 100.00                     | 100.00                   | 100.00         | 0.00   |
| 11N20SISO | Ant1    | 2437           | 100.00                     | 100.00                   | 100.00         | 0.00   |
| 11N20SISO | Ant1    | 2462           | 100.00                     | 100.00                   | 100.00         | 0.00   |
| 11N40SISO | Ant1    | 2422           | 100.00                     | 100.00                   | 100.00         | 0.00   |
| 11N40SISO | Ant1    | 2437           | 100.00                     | 100.00                   | 100.00         | 0.00   |
| 11N40SISO | Ant1    | 2452           | 100.00                     | 100.00                   | 100.00         | 0.00   |


## Test Graphs

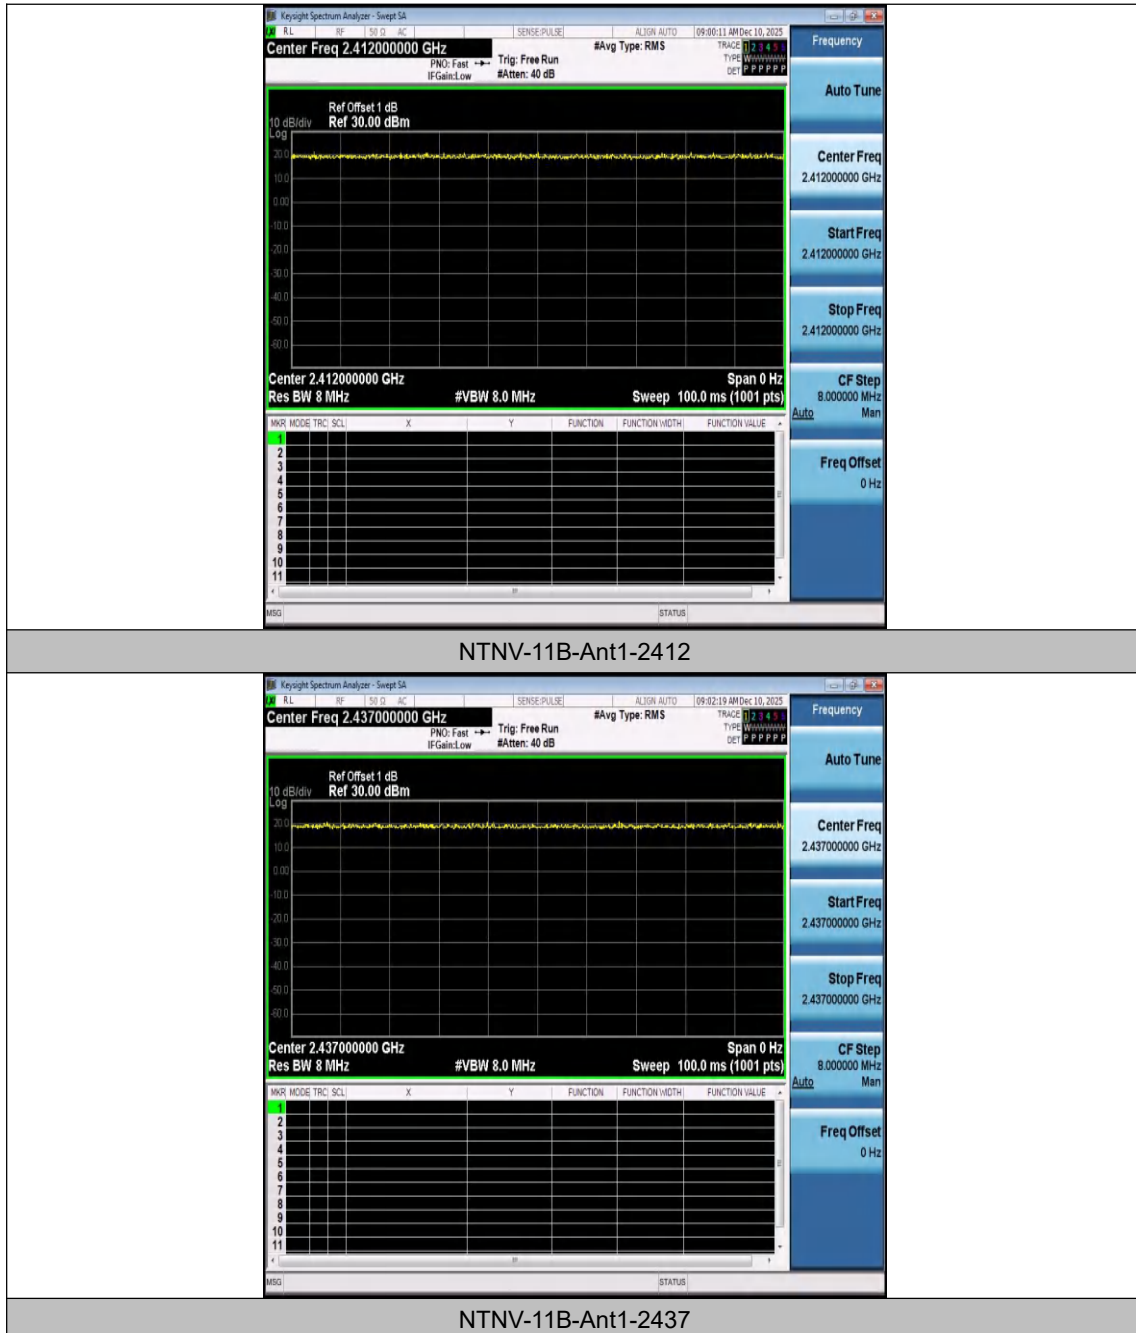

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

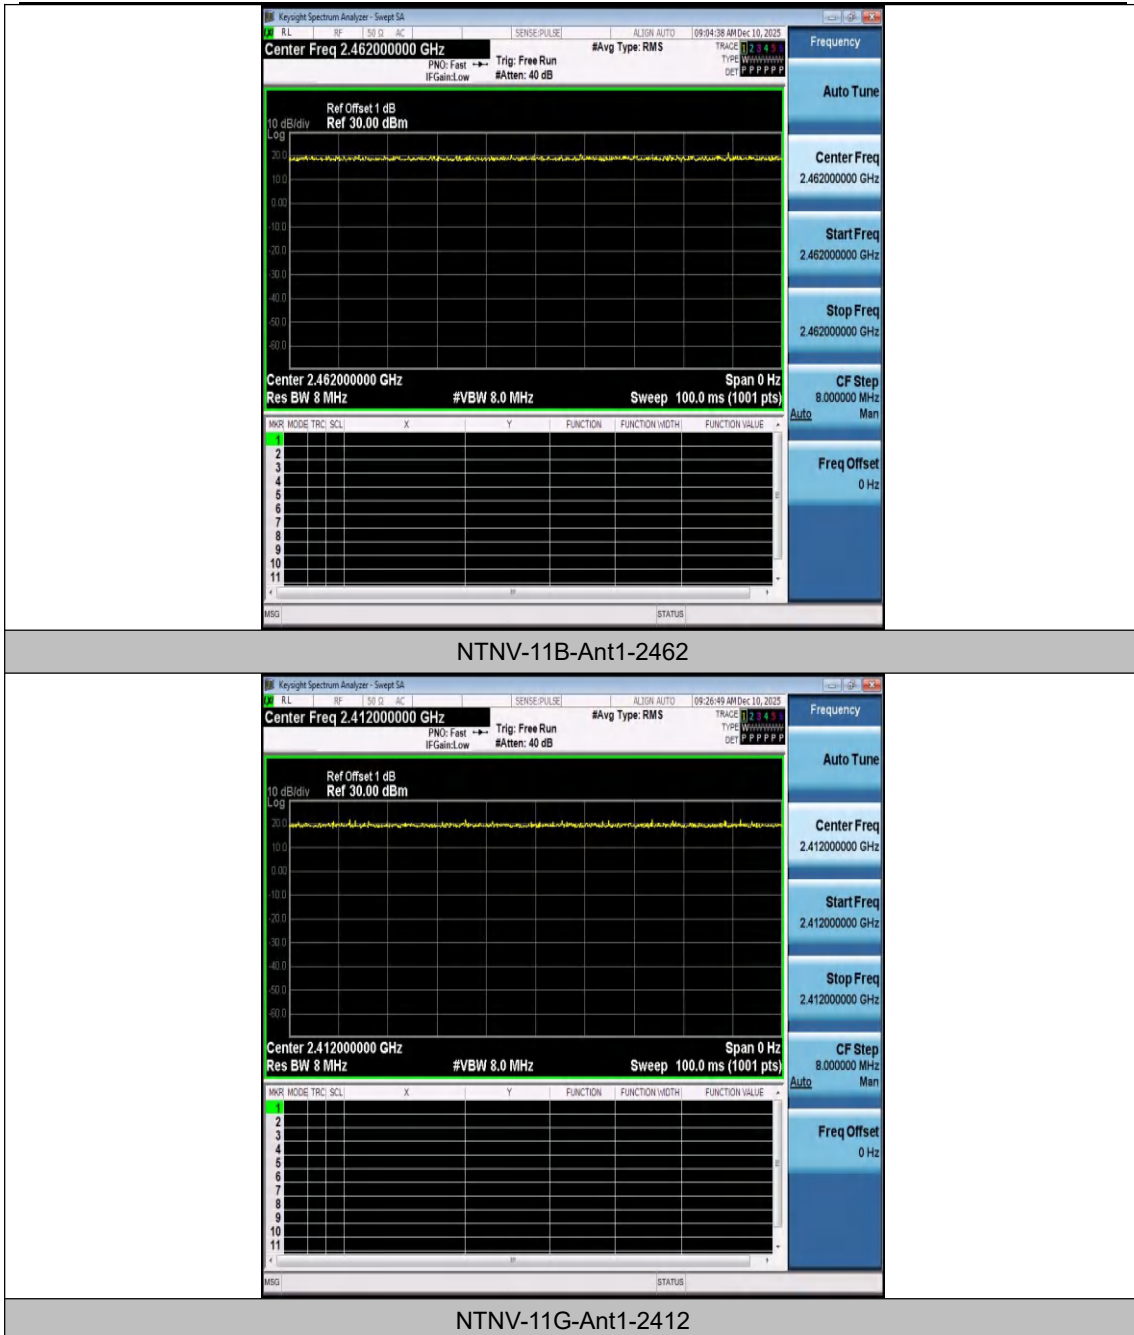

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

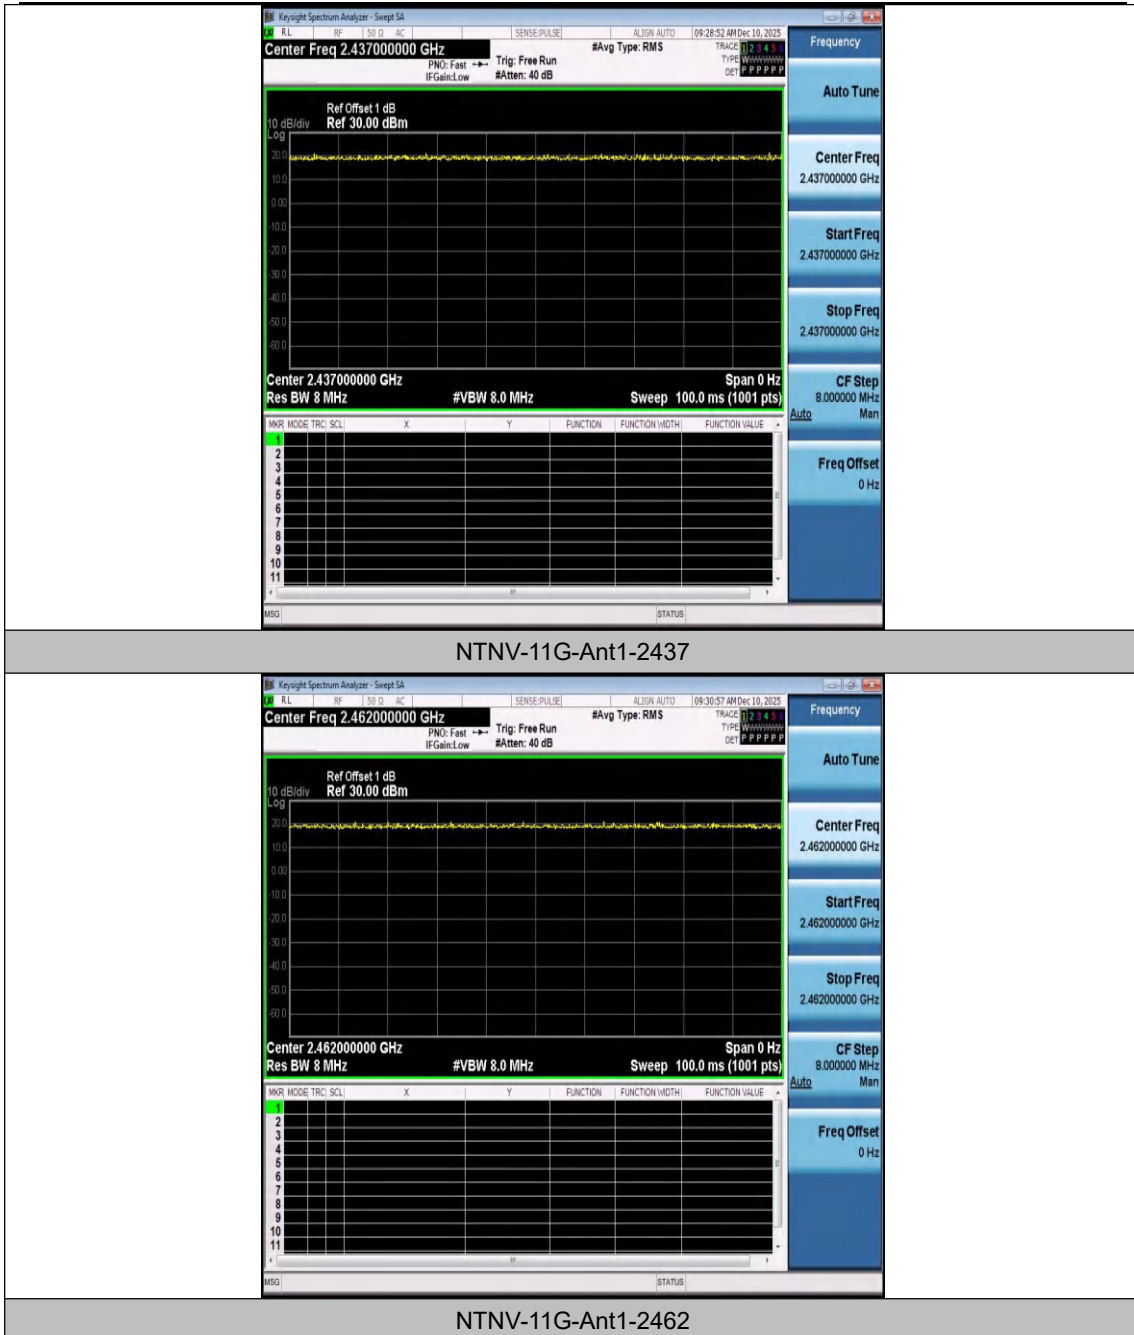

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

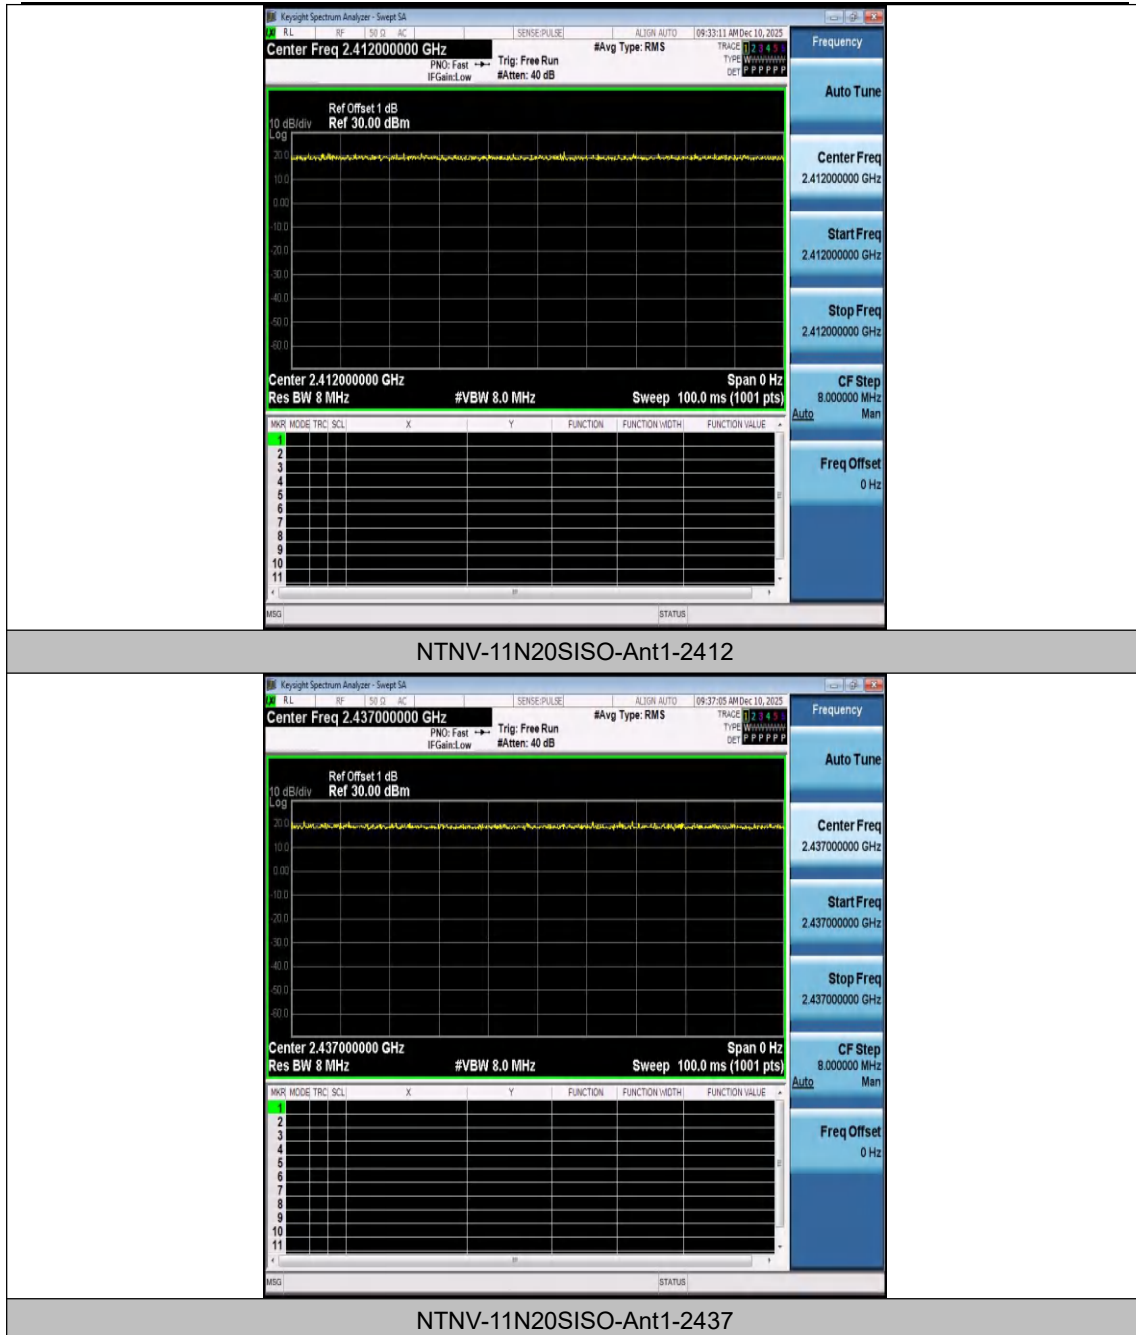

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

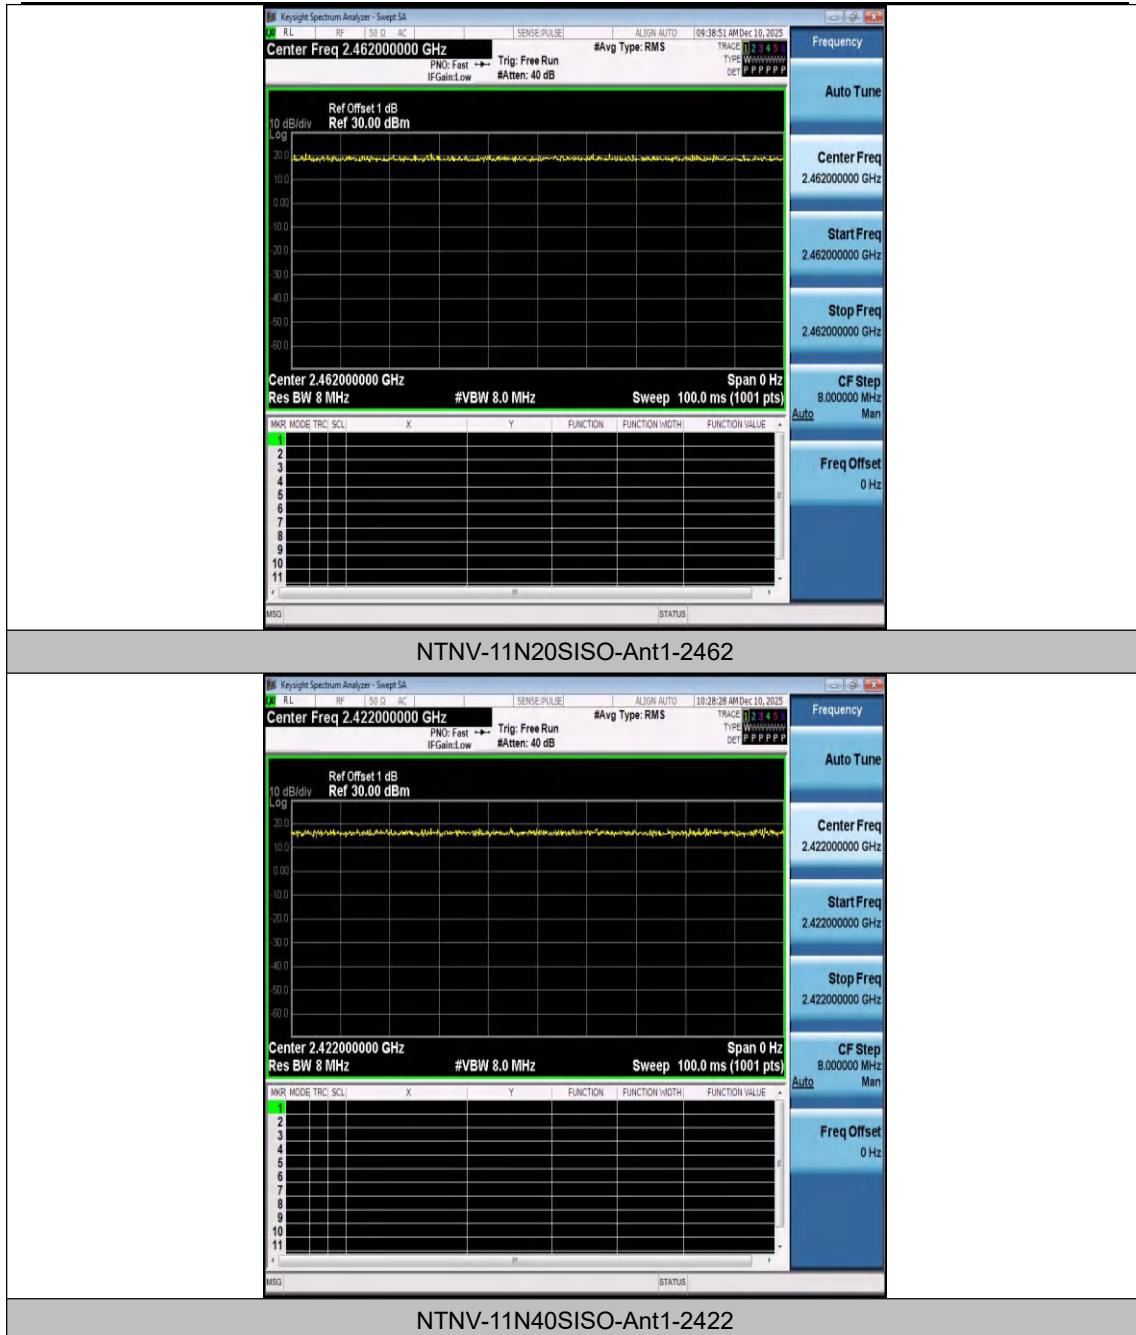

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

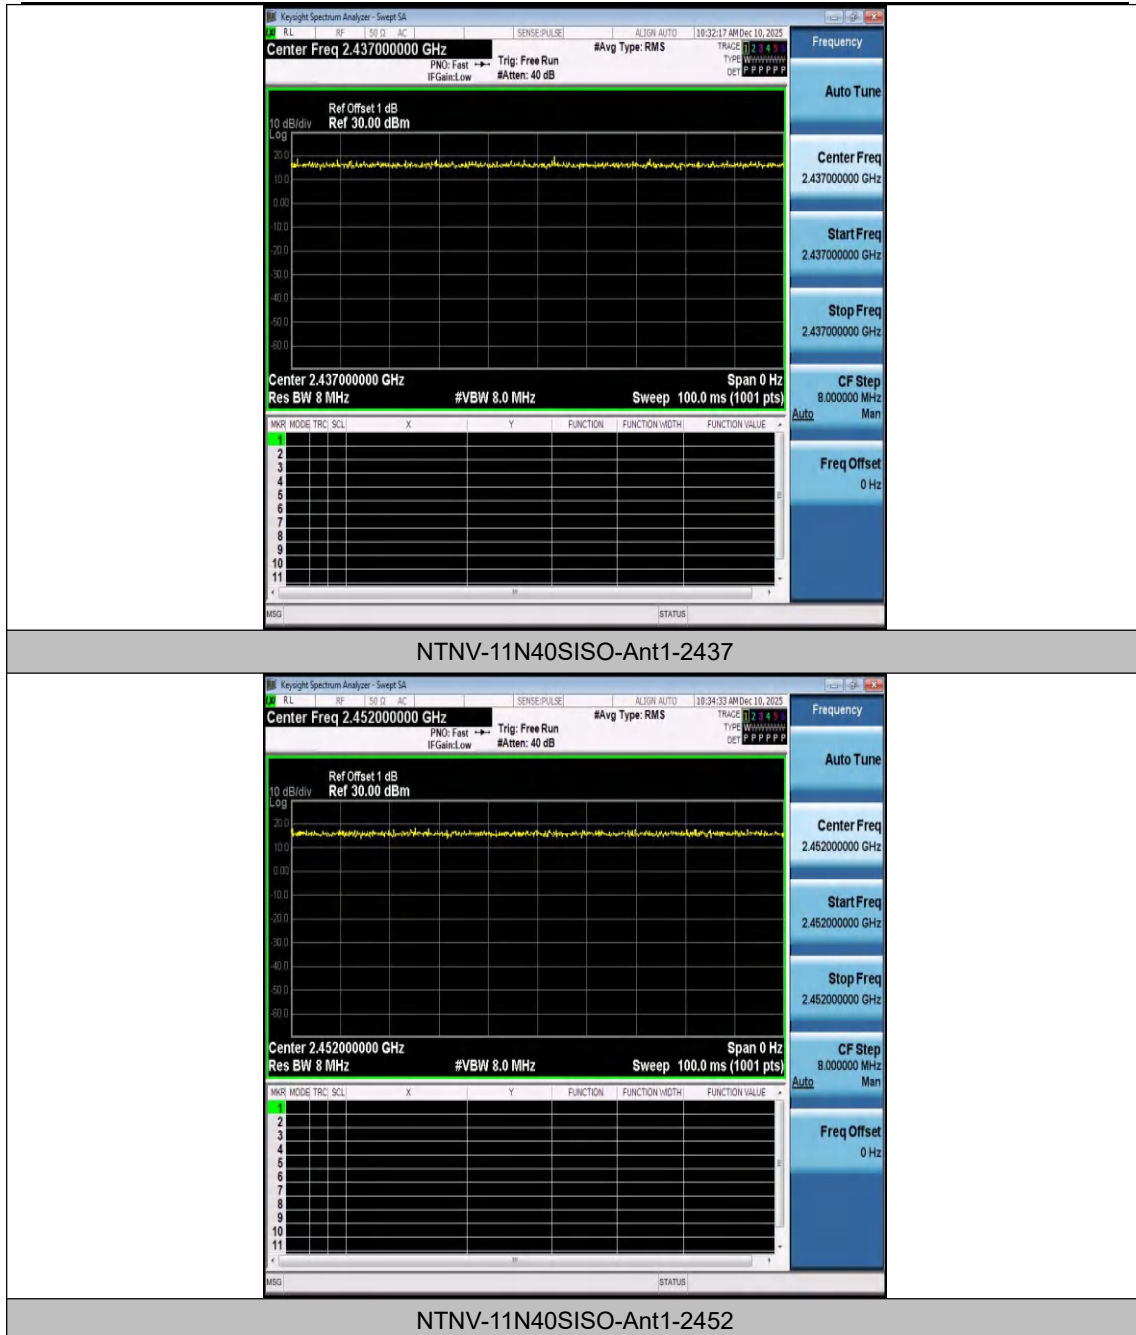

---End---