

Appendix Test Data

Report No:	1812C40122812504	Test Sample NO:	1-2-2
Start Test Date:	2024.11.6	Finish Test Date:	2024.12.30
Test Engineer:	<i>Joker Huang</i>	Auditor:	<i>Justin Feng</i>
Temperature:	22.5°C	Relative Humidity:	56%
Pressure:	101 kPa		

Appendix A1: Emission Bandwidth

Test Result

TestMode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	19.60	5169.84	5189.44	---	---
11A	Ant1	5200	19.08	5190.56	5209.64	---	---
11A	Ant1	5240	18.76	5230.48	5249.24	---	---
11A	Ant1	5745	19.24	5735.20	5754.44	---	---
11A	Ant1	5785	19.72	5774.84	5794.56	---	---
11A	Ant1	5825	19.24	5815.44	5834.68	---	---
11N20SISO	Ant1	5180	20.28	5169.76	5190.04	---	---
11N20SISO	Ant1	5200	20.40	5189.72	5210.12	---	---
11N20SISO	Ant1	5240	20.40	5229.72	5250.12	---	---
11N20SISO	Ant1	5745	19.24	5735.32	5754.56	---	---
11N20SISO	Ant1	5785	19.84	5774.96	5794.80	---	---
11N20SISO	Ant1	5825	19.08	5815.48	5834.56	---	---
11N40SISO	Ant1	5190	39.68	5169.92	5209.60	---	---
11N40SISO	Ant1	5230	39.36	5210.56	5249.92	---	---
11N40SISO	Ant1	5755	39.44	5735.16	5774.60	---	---
11N40SISO	Ant1	5795	38.80	5775.40	5814.20	---	---
11AC20SISO	Ant1	5180	20.00	5170.00	5190.00	---	---
11AC20SISO	Ant1	5200	19.48	5190.12	5209.60	---	---
11AC20SISO	Ant1	5240	19.84	5230.12	5249.96	---	---
11AC20SISO	Ant1	5745	20.16	5734.68	5754.84	---	---
11AC20SISO	Ant1	5785	19.76	5775.04	5794.80	---	---
11AC20SISO	Ant1	5825	19.68	5815.16	5834.84	---	---
11AC40SISO	Ant1	5190	39.28	5170.40	5209.68	---	---



11AC40SISO	Ant1	5230	39.04	5210.56	5249.60	---	---
11AC40SISO	Ant1	5755	39.52	5735.08	5774.60	---	---
11AC40SISO	Ant1	5795	39.44	5775.16	5814.60	---	---
11AC80SISO	Ant1	5210	79.84	5170.16	5250.00	---	---
11AC80SISO	Ant1	5775	79.04	5735.48	5814.52	---	---

Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com





Hotline
400-003-0500
www.anbotek.com




Test Graphs

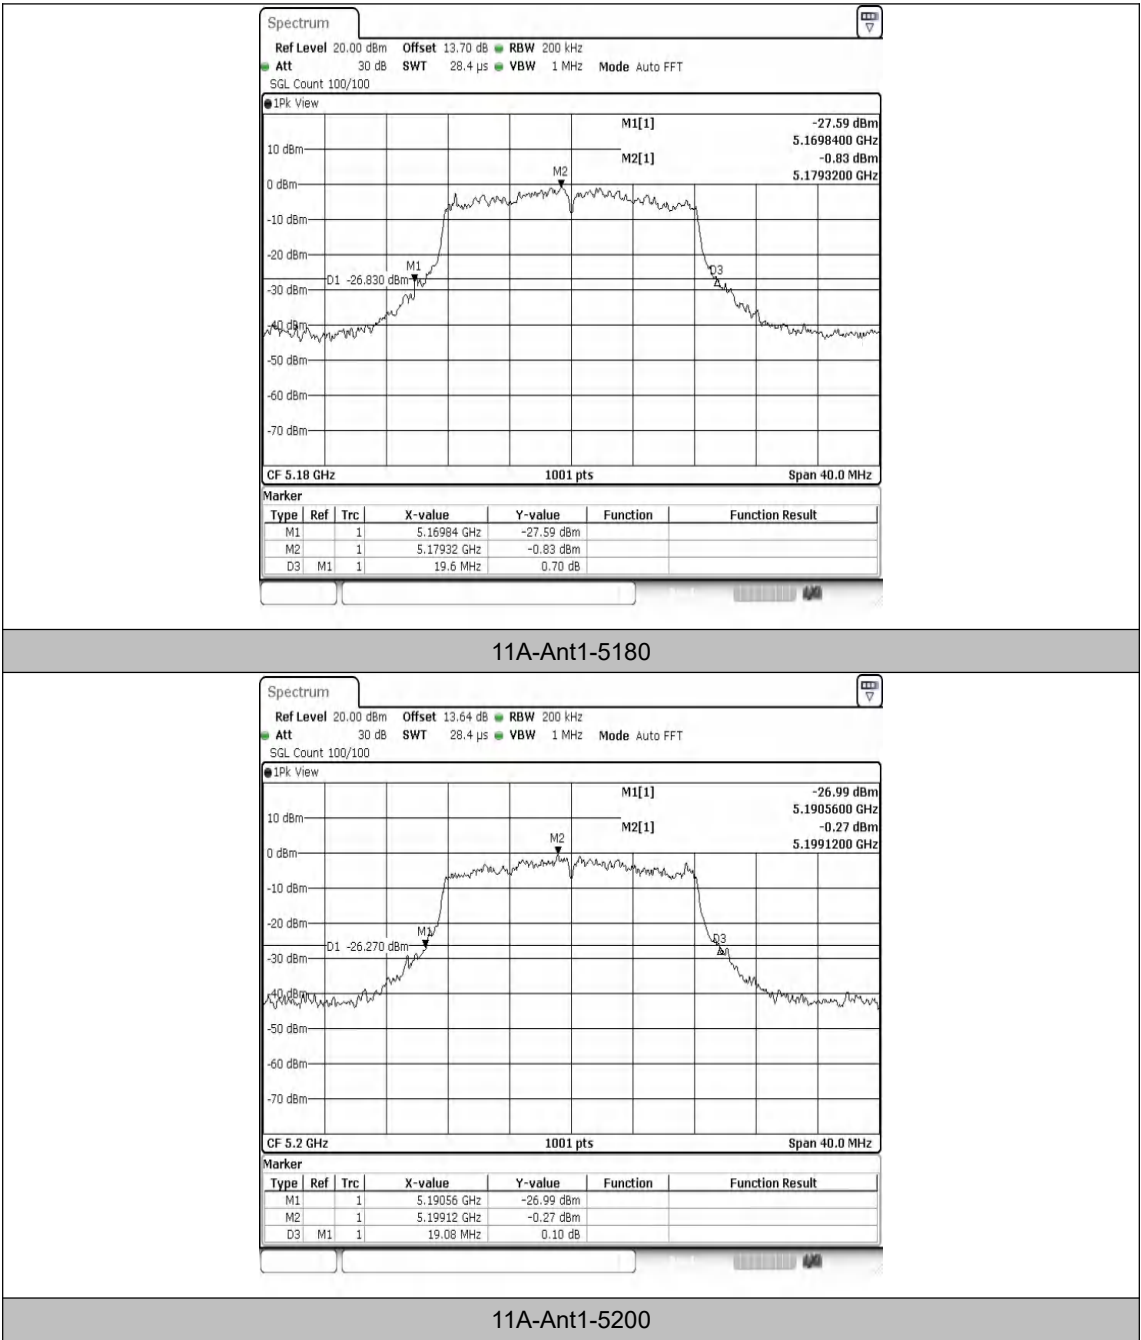

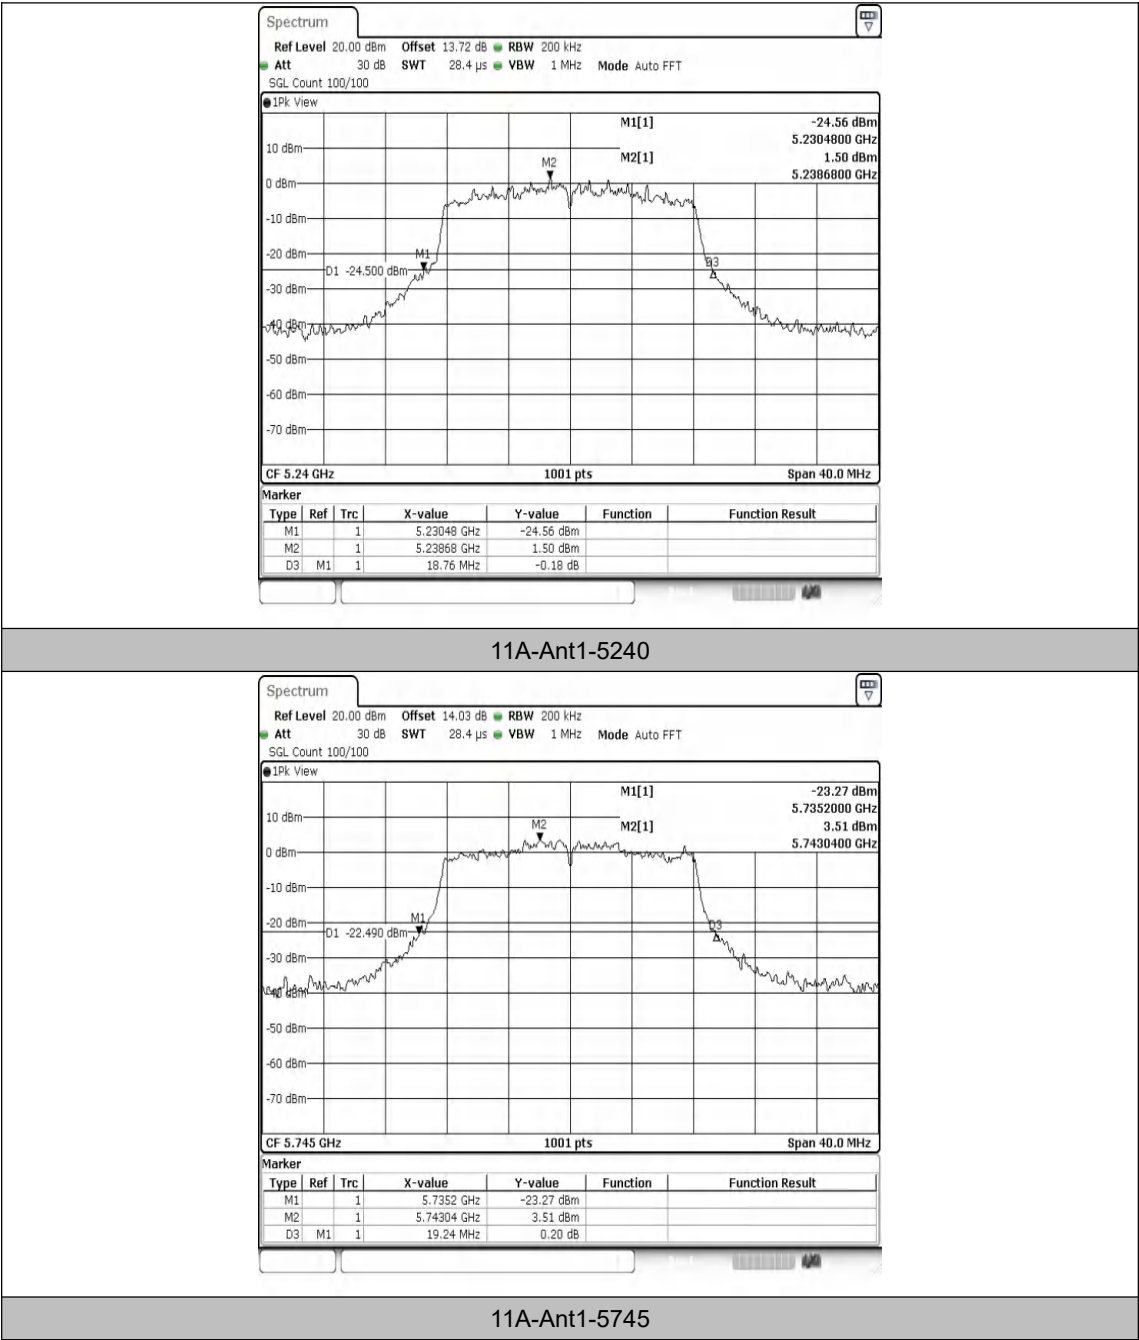

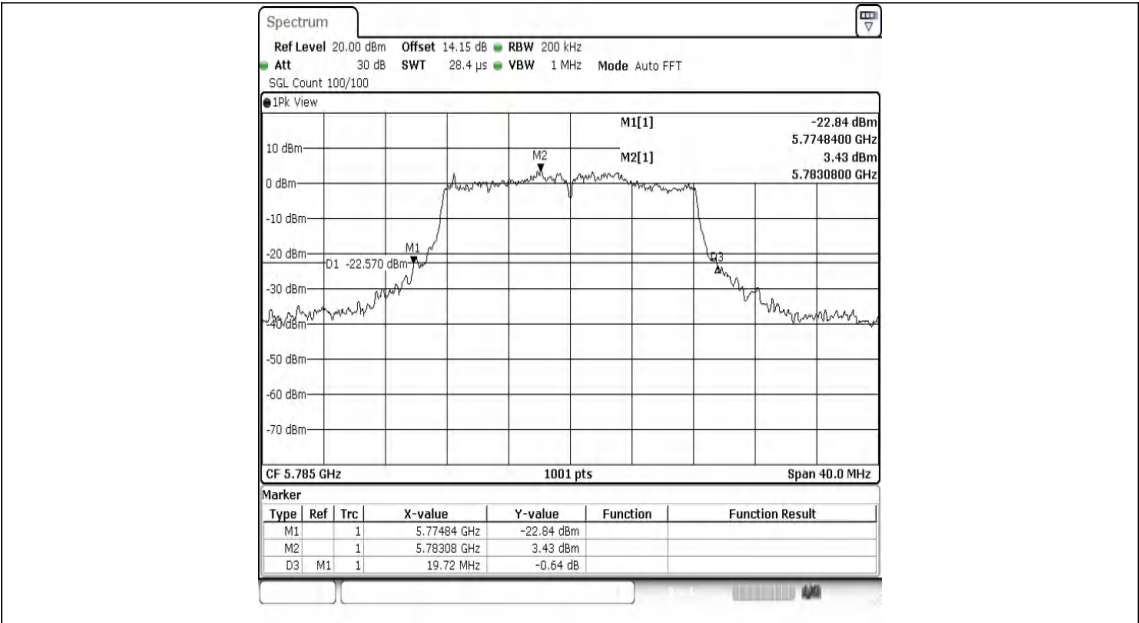



11A-Ant1-5785

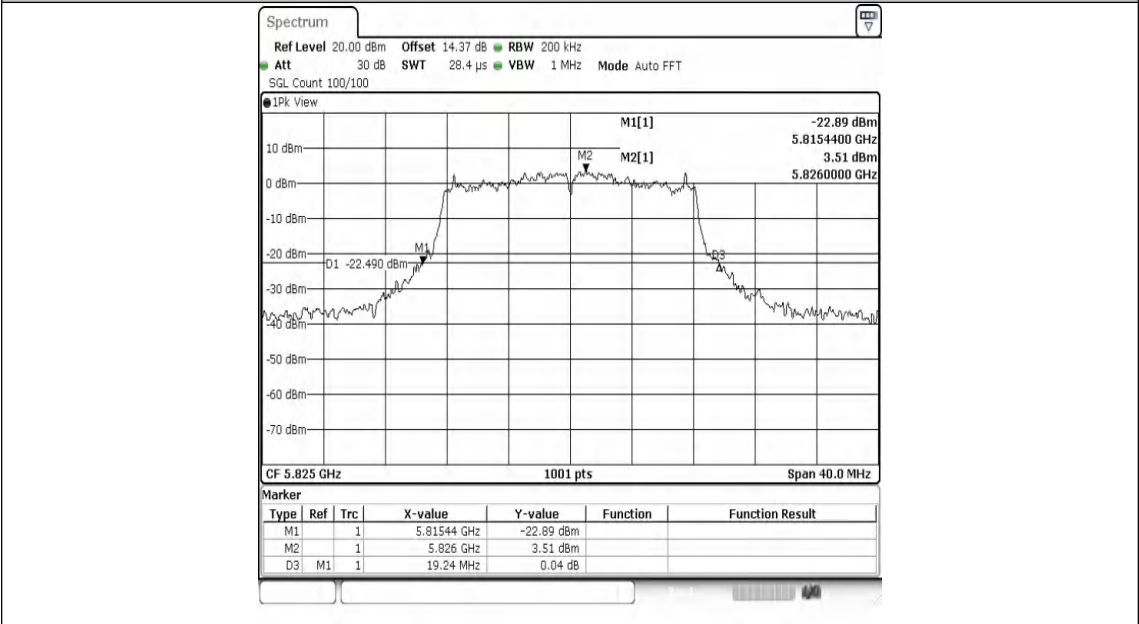



11A-Ant1-5825




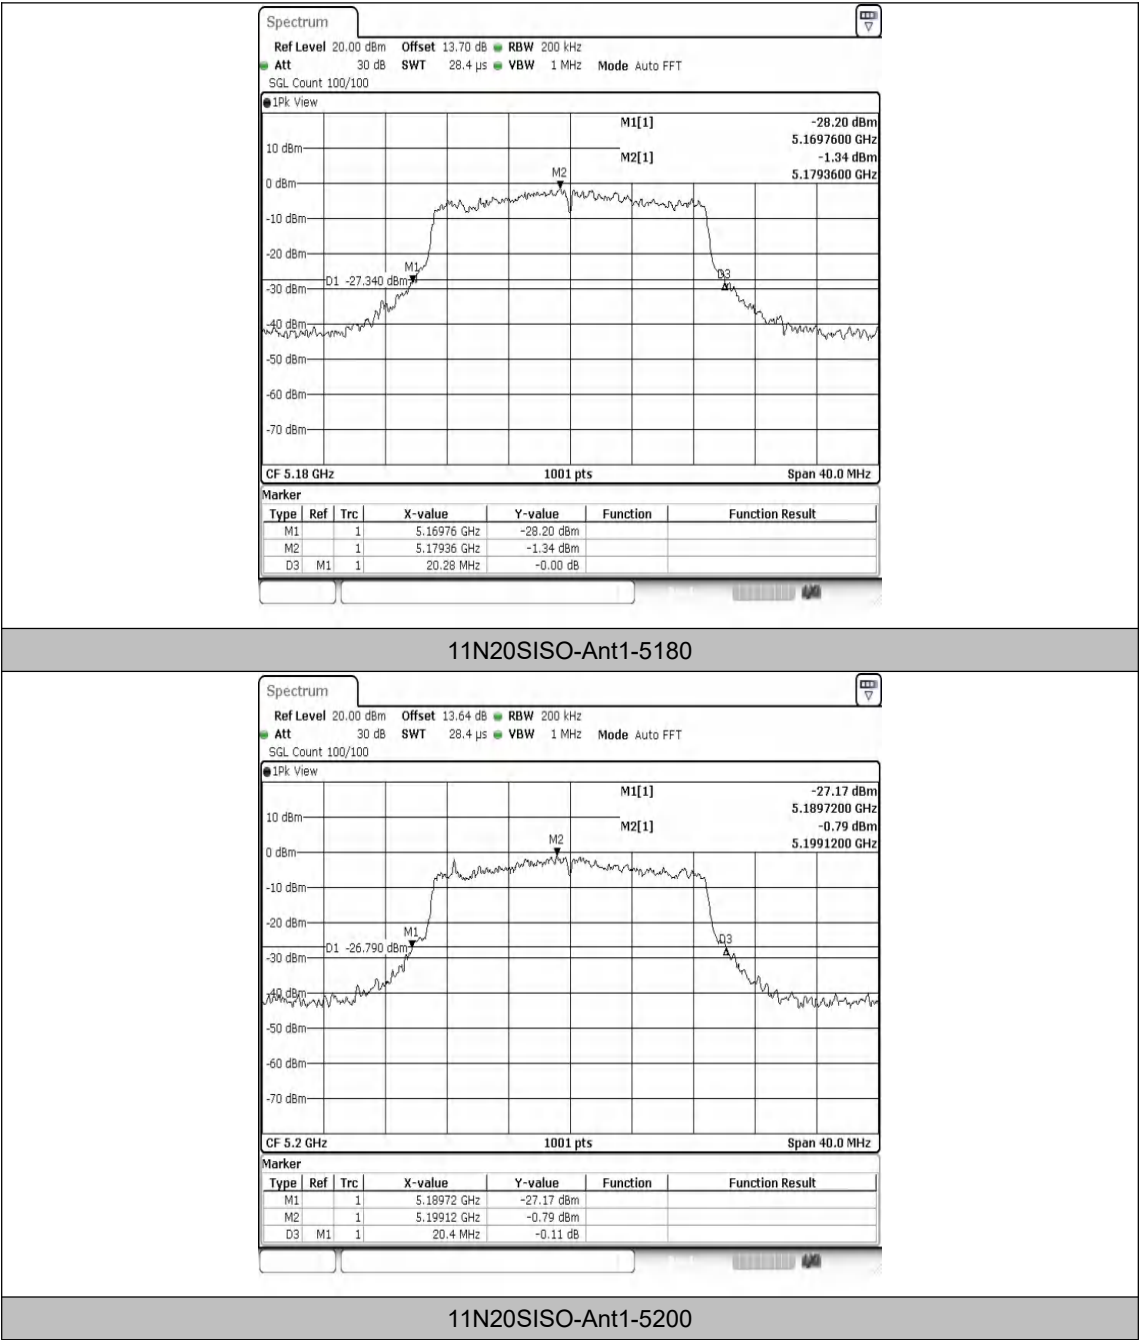


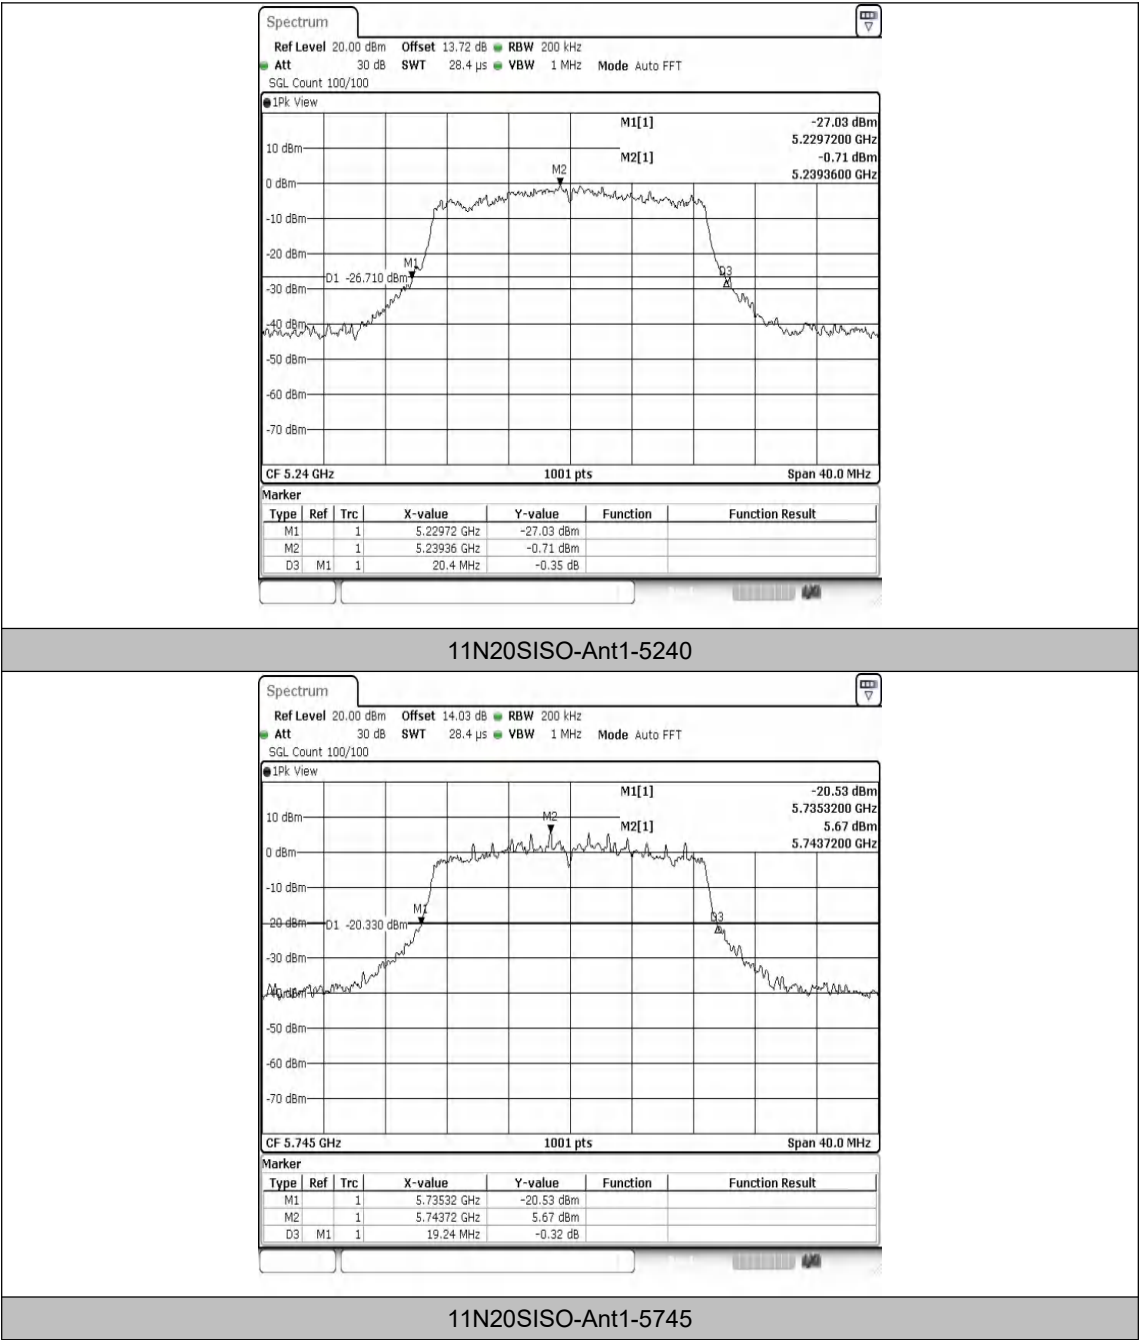

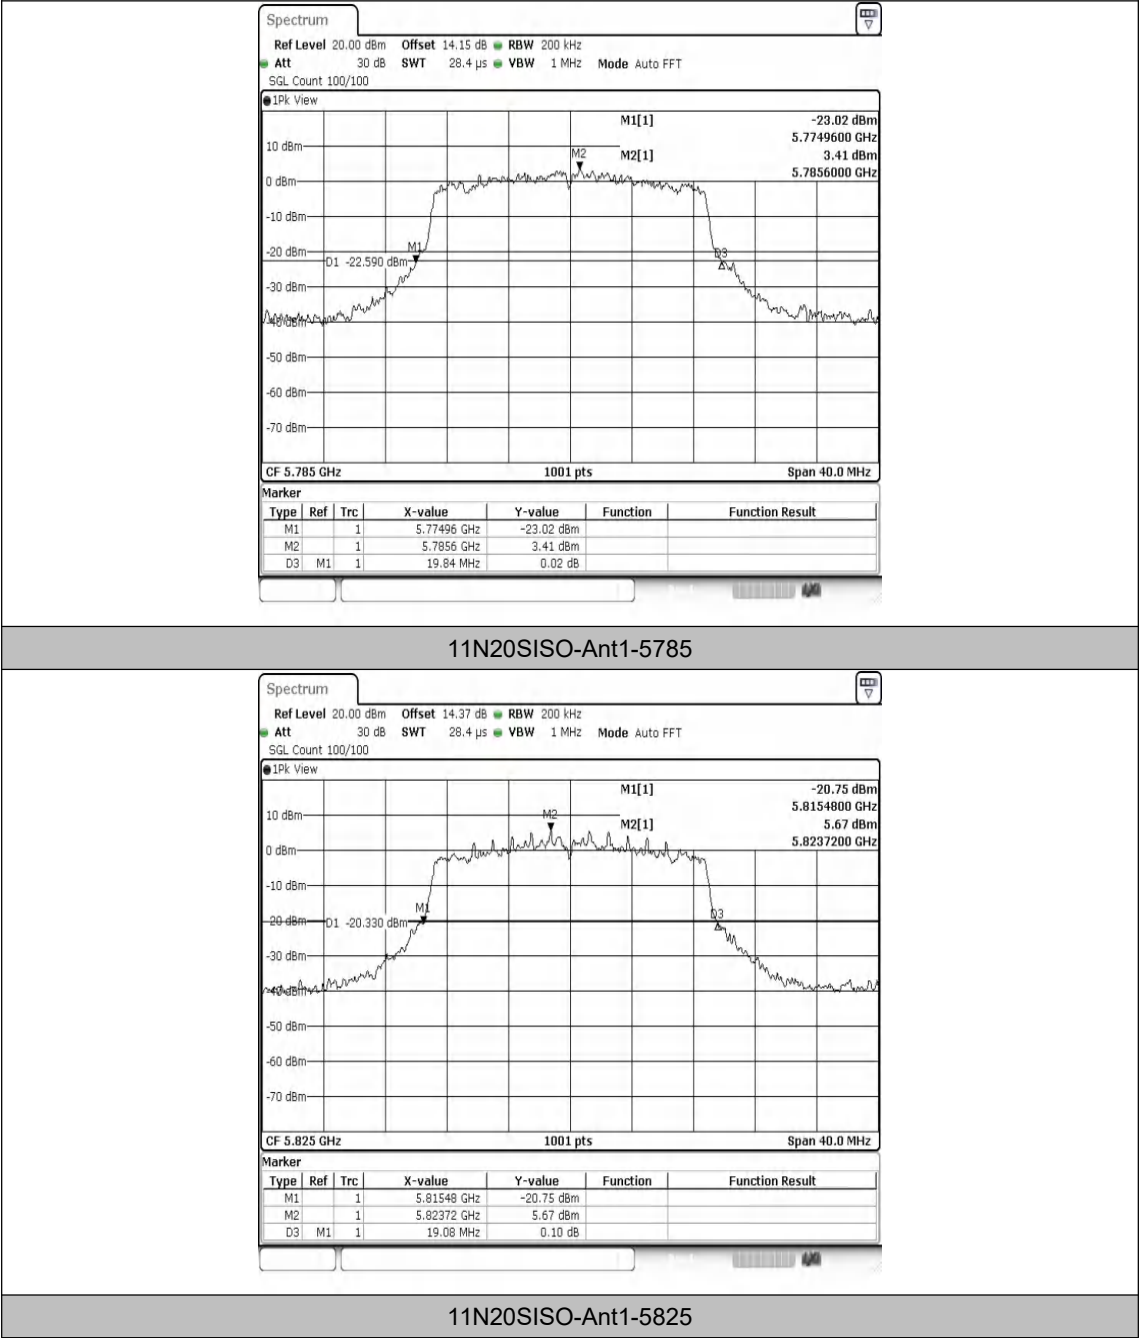


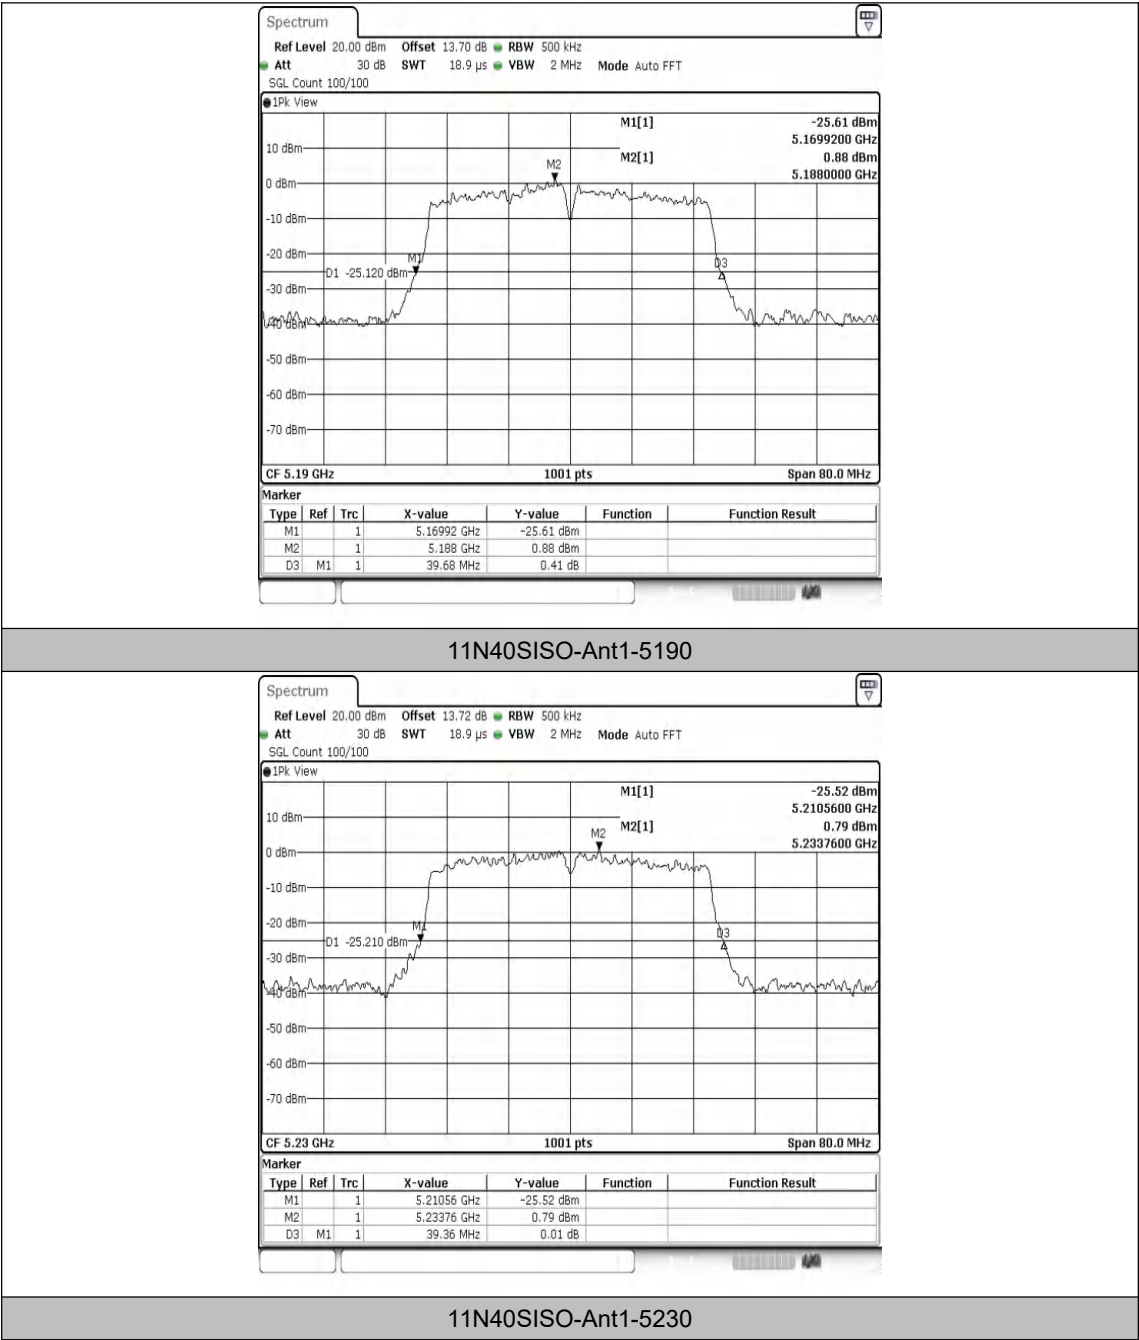

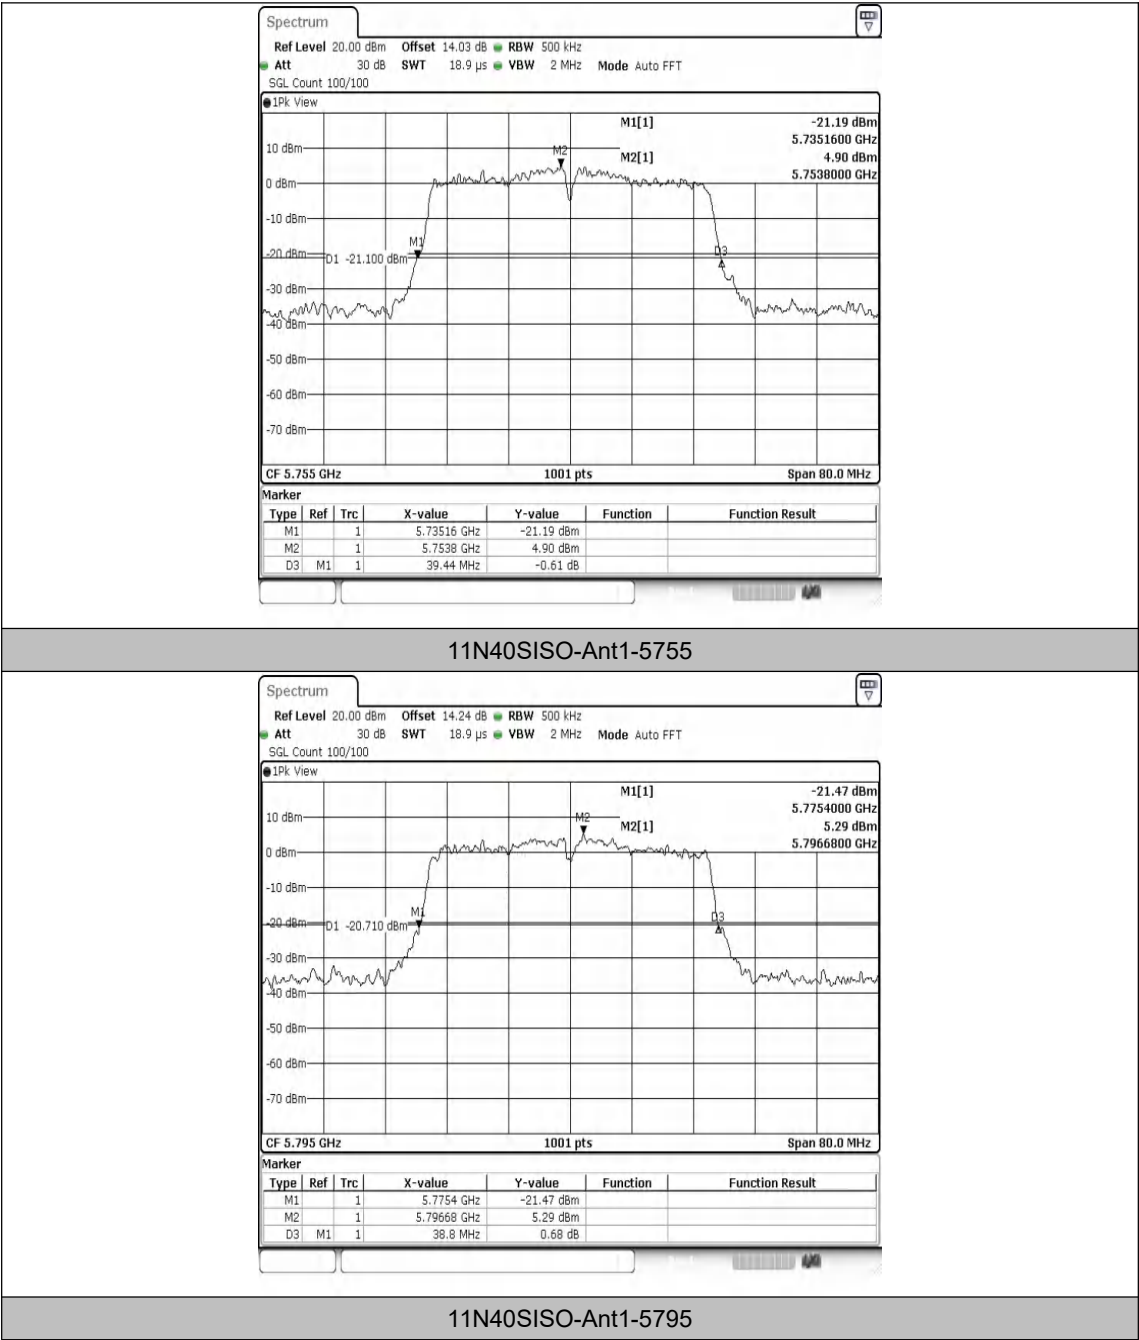

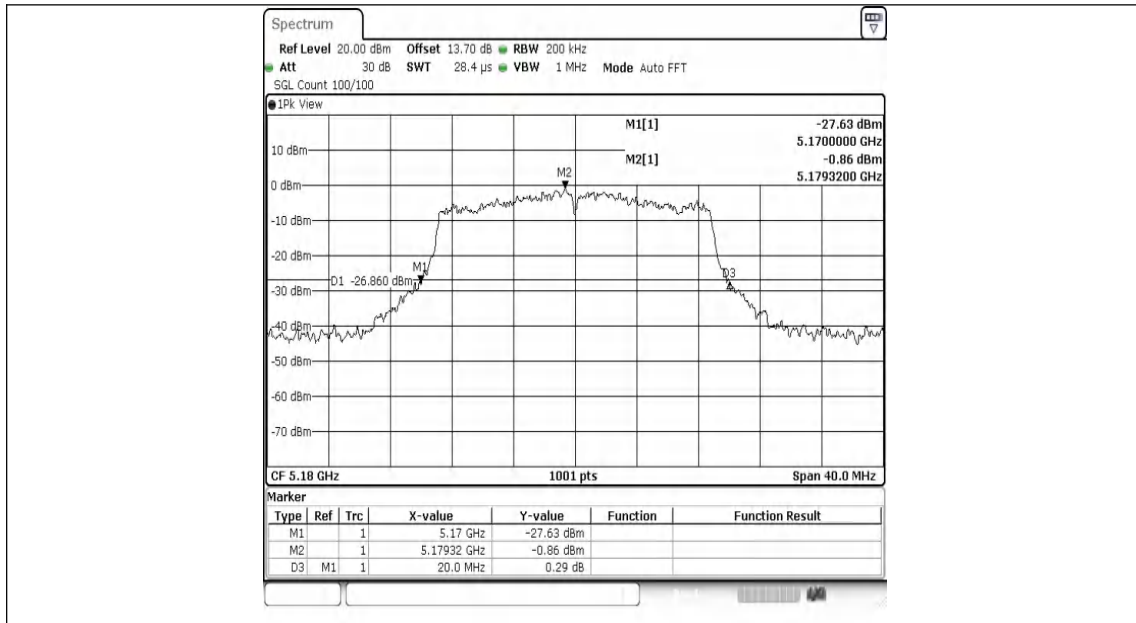



11AC20SISO-Ant1-5180

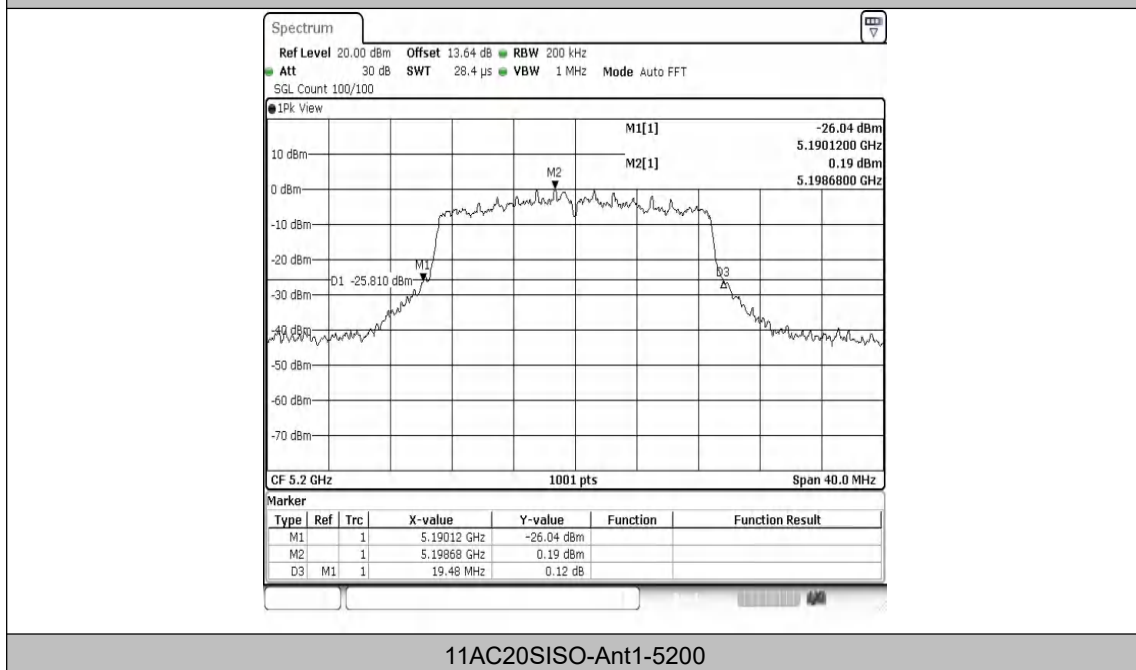



11AC20SISO-Ant1-5200




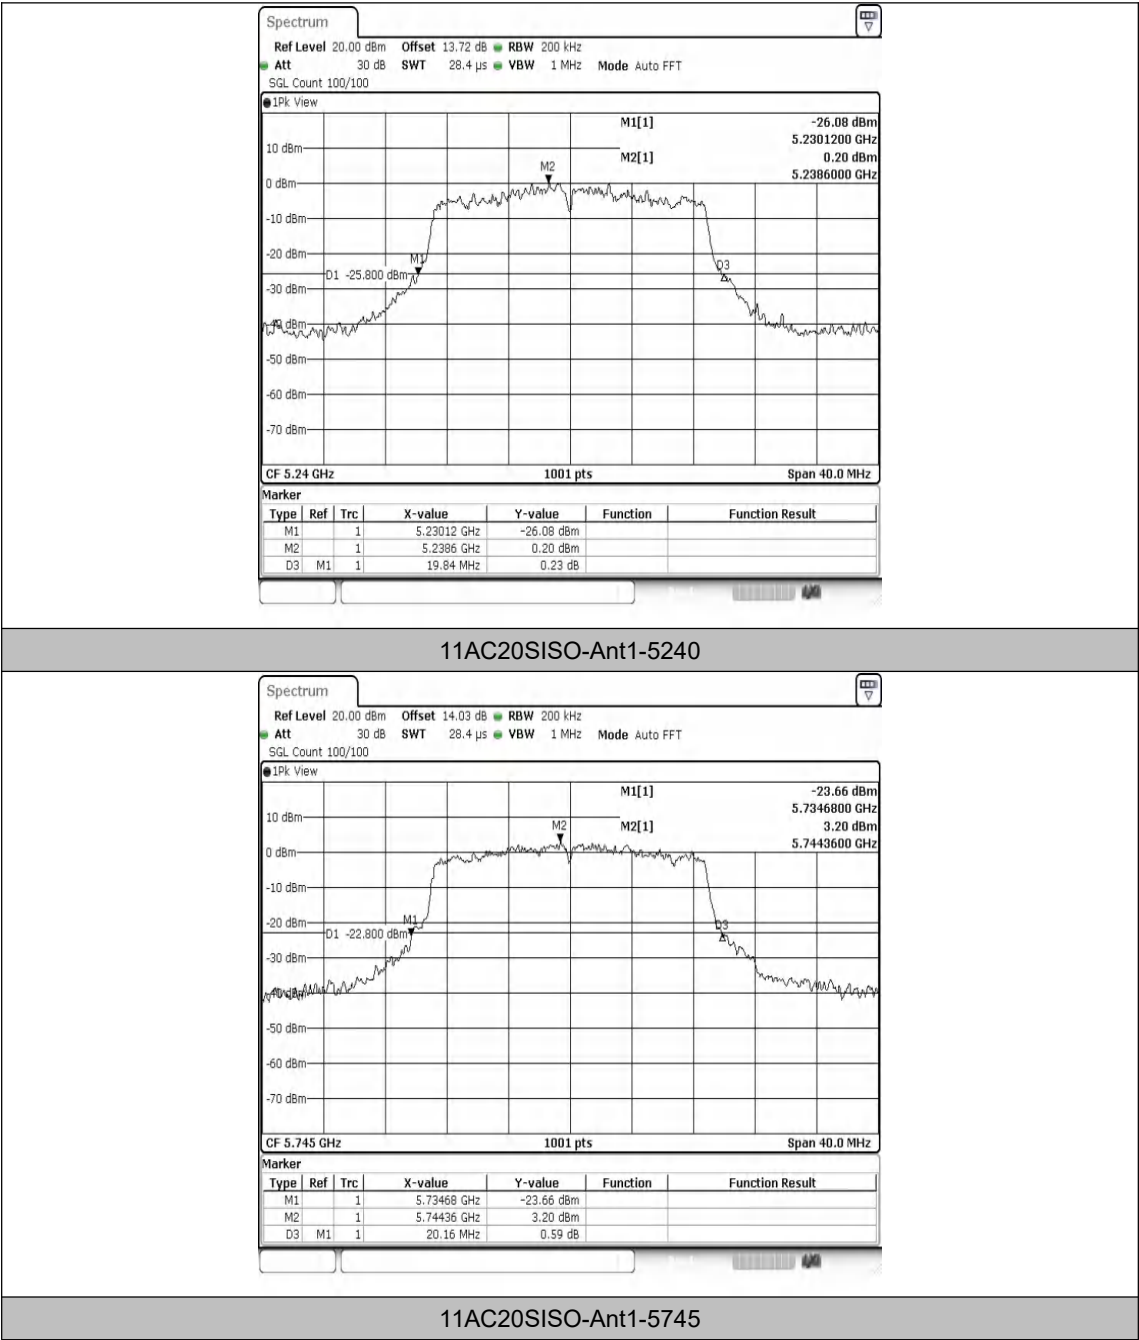

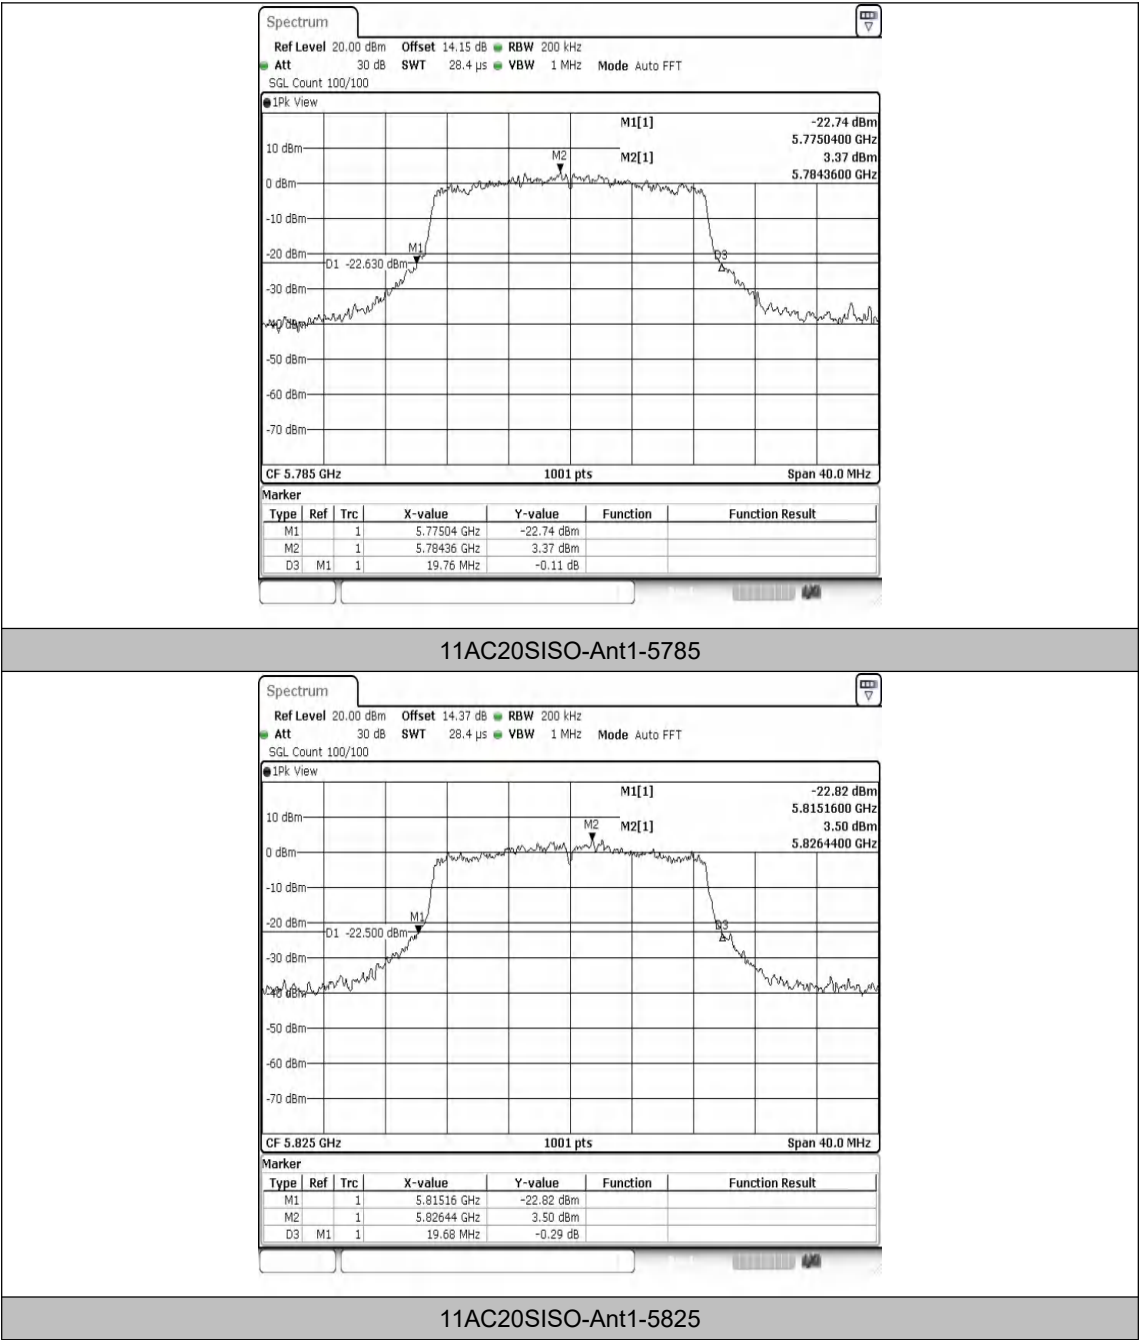


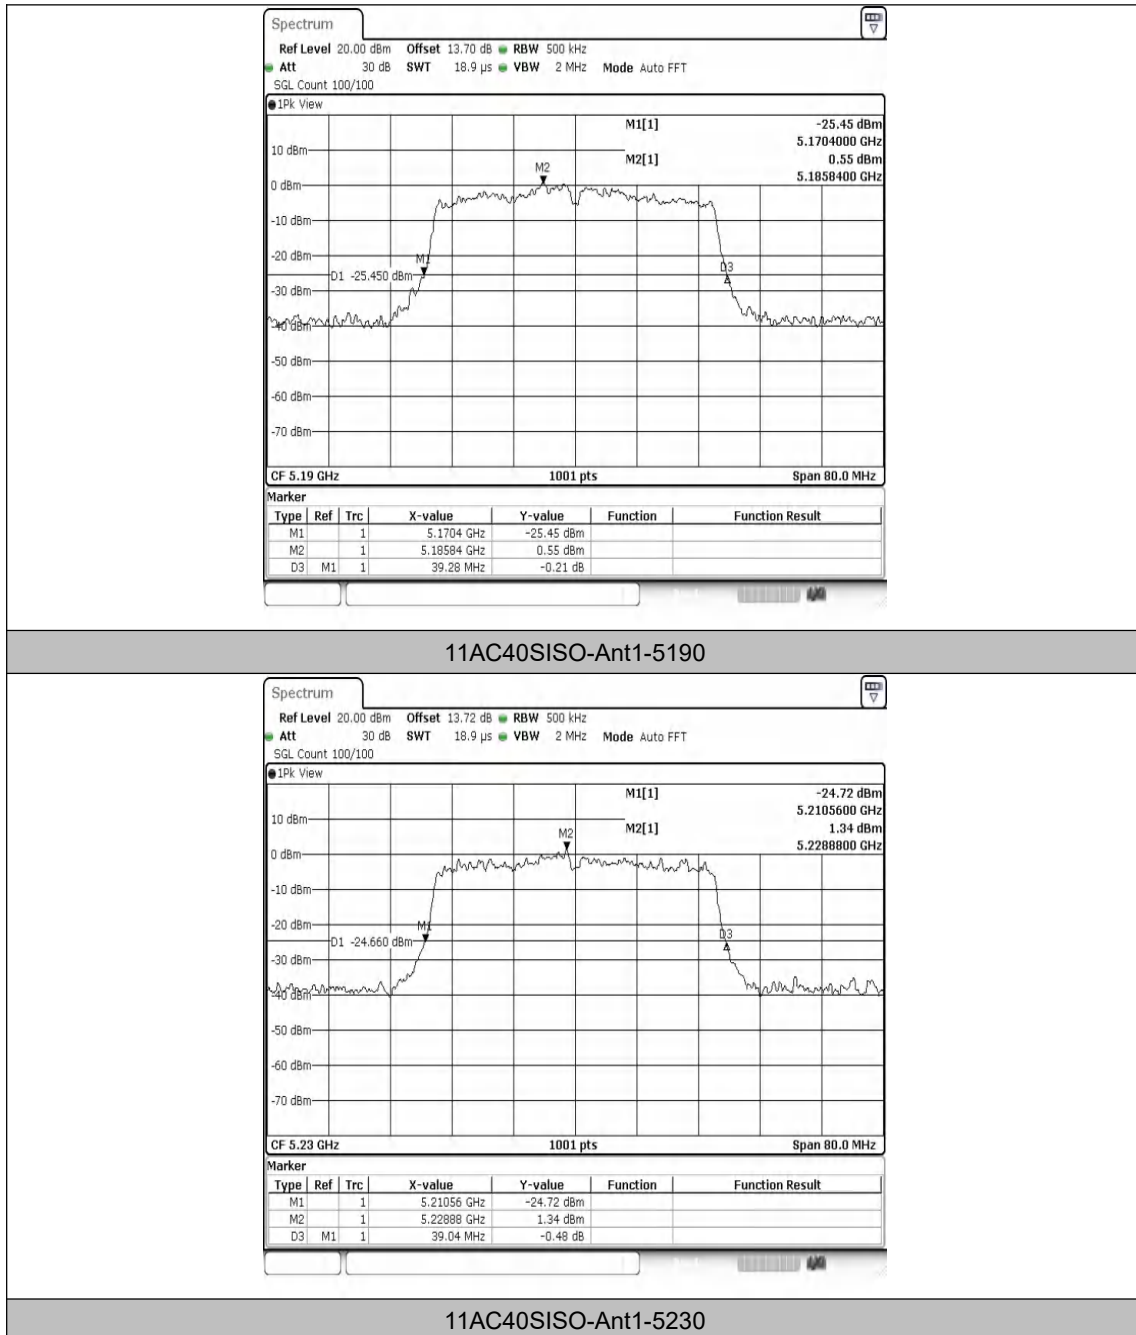

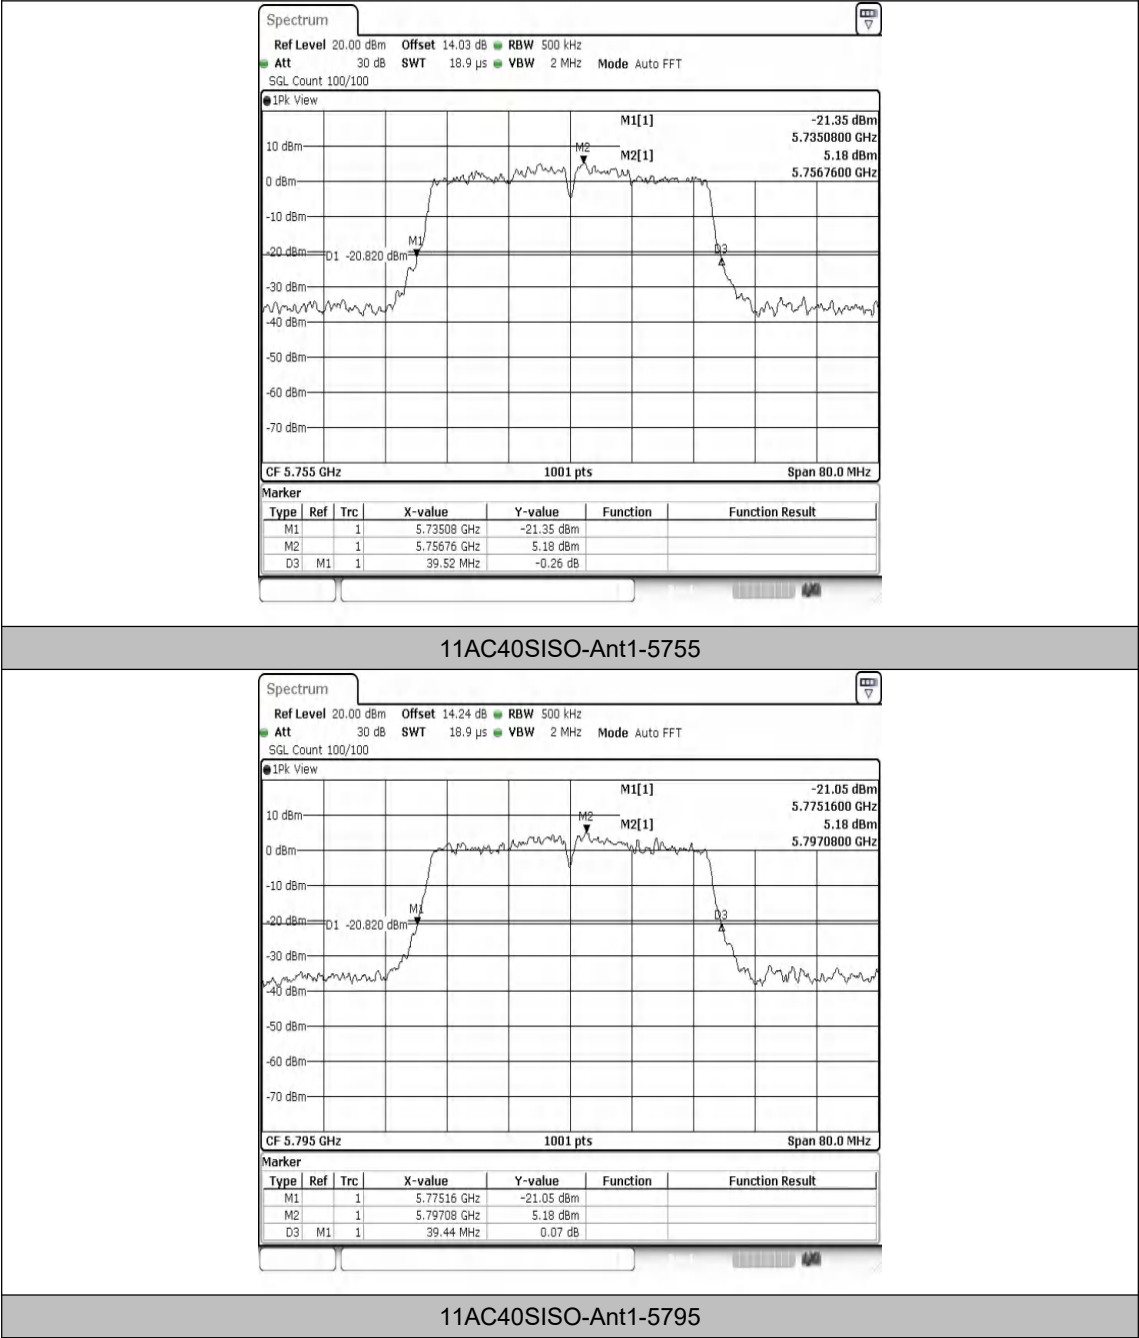

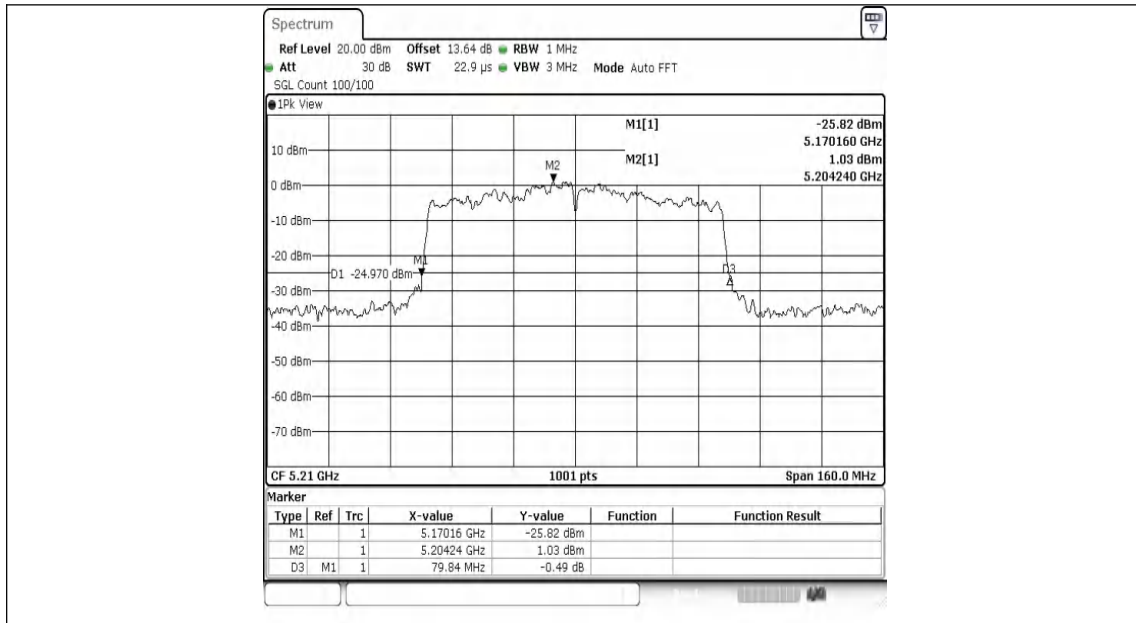

11AC80SISO-Ant1-5210

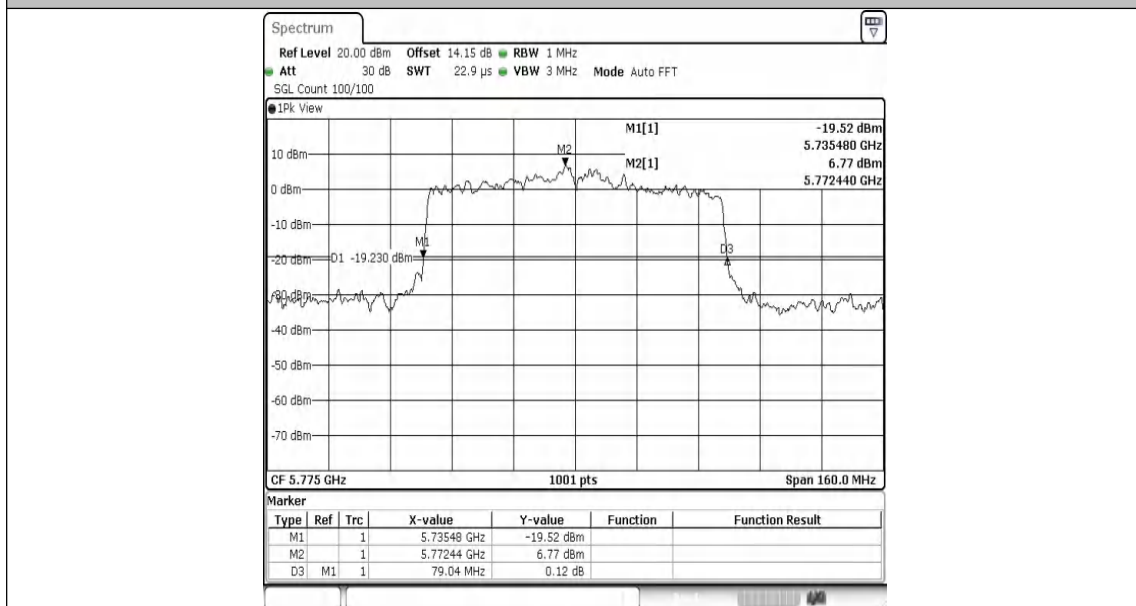

11AC80SISO-Ant1-5775




Appendix A2: Occupied channel bandwidth


Test Result


TestMode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.503	5171.7283	5188.2318	---	---
11A	Ant1	5200	16.424	5191.7283	5208.1518	---	---
11A	Ant1	5240	16.424	5231.7682	5248.1918	---	---
11A	Ant1	5745	16.503	5736.7283	5753.2318	---	---
11A	Ant1	5785	16.464	5776.7283	5793.1918	---	---
11A	Ant1	5825	16.464	5816.7682	5833.2318	---	---
11N20SISO	Ant1	5180	17.622	5171.1688	5188.7912	---	---
11N20SISO	Ant1	5200	17.702	5191.0889	5208.7912	---	---
11N20SISO	Ant1	5240	17.622	5231.1688	5248.7912	---	---
11N20SISO	Ant1	5745	17.582	5736.1688	5753.7512	---	---
11N20SISO	Ant1	5785	17.582	5776.2088	5793.7912	---	---
11N20SISO	Ant1	5825	17.622	5816.2088	5833.8312	---	---
11N40SISO	Ant1	5190	36.044	5171.9381	5207.9820	---	---
11N40SISO	Ant1	5230	36.044	5212.0180	5248.0619	---	---
11N40SISO	Ant1	5755	36.044	5736.9381	5772.9820	---	---
11N40SISO	Ant1	5795	36.204	5776.7782	5812.9820	---	---
11AC20SISO	Ant1	5180	17.662	5171.2088	5188.8711	---	---
11AC20SISO	Ant1	5200	17.662	5191.1688	5208.8312	---	---
11AC20SISO	Ant1	5240	17.582	5231.2088	5248.7912	---	---
11AC20SISO	Ant1	5745	17.662	5736.1688	5753.8312	---	---
11AC20SISO	Ant1	5785	17.582	5776.1688	5793.7512	---	---
11AC20SISO	Ant1	5825	17.542	5816.2488	5833.7912	---	---
11AC40SISO	Ant1	5190	35.964	5172.0180	5207.9820	---	---
11AC40SISO	Ant1	5230	36.124	5211.9381	5248.0619	---	---
11AC40SISO	Ant1	5755	36.124	5736.9381	5773.0619	---	---
11AC40SISO	Ant1	5795	36.124	5776.8581	5812.9820	---	---
11AC80SISO	Ant1	5210	75.285	5172.2777	5247.5624	---	---
11AC80SISO	Ant1	5775	75.285	5737.2777	5812.5624	---	---




Test Graphs

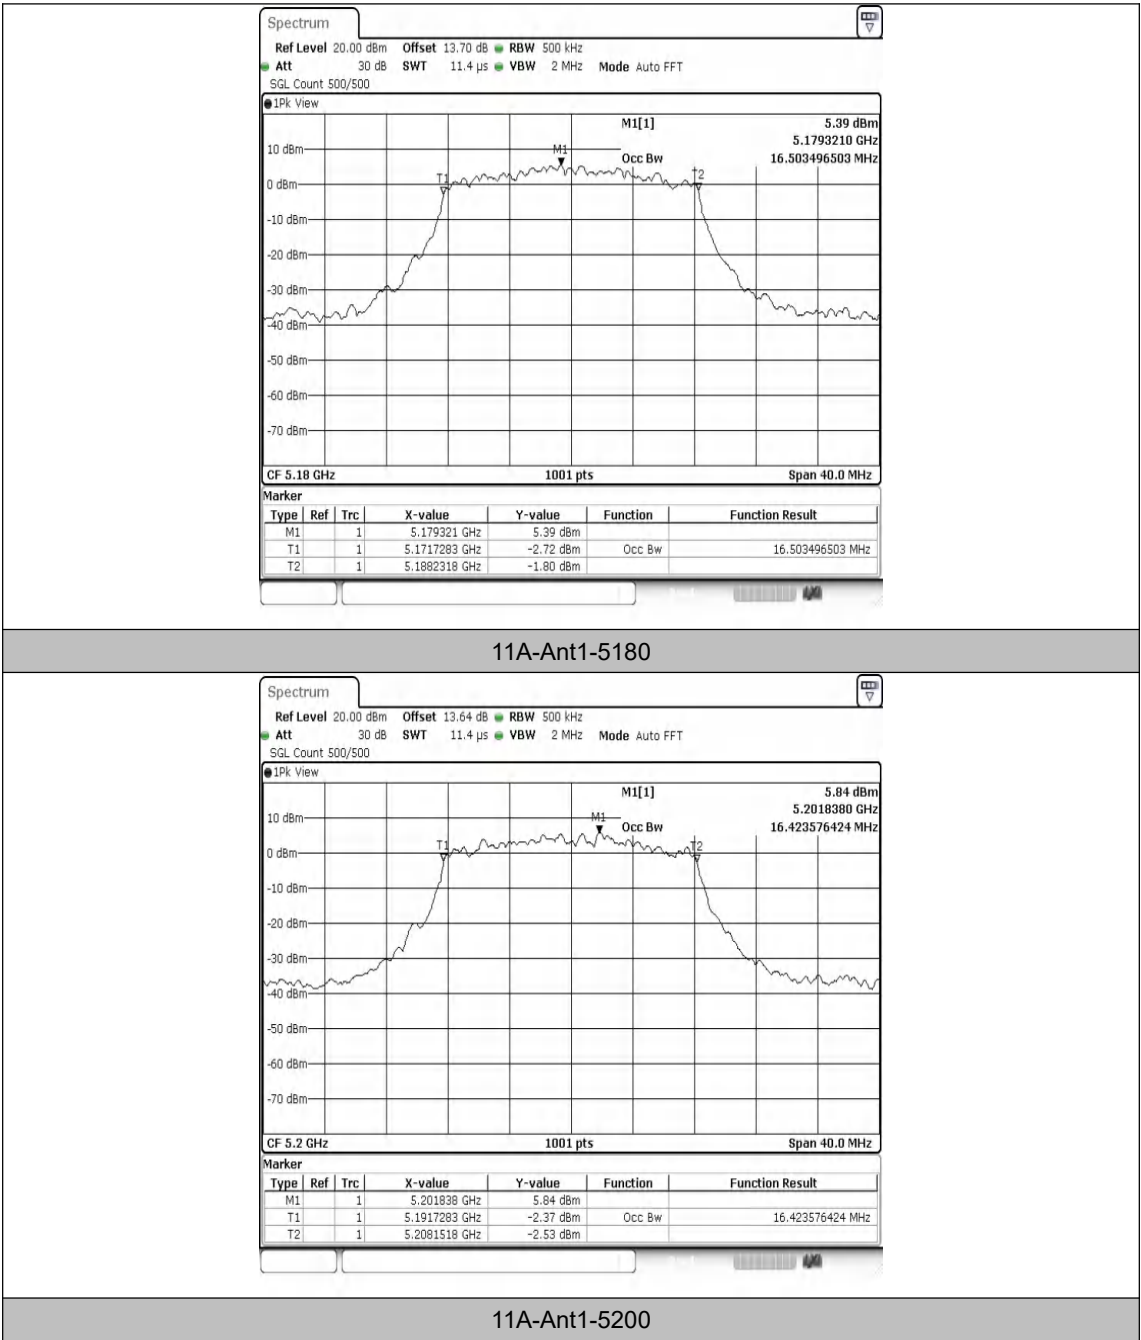

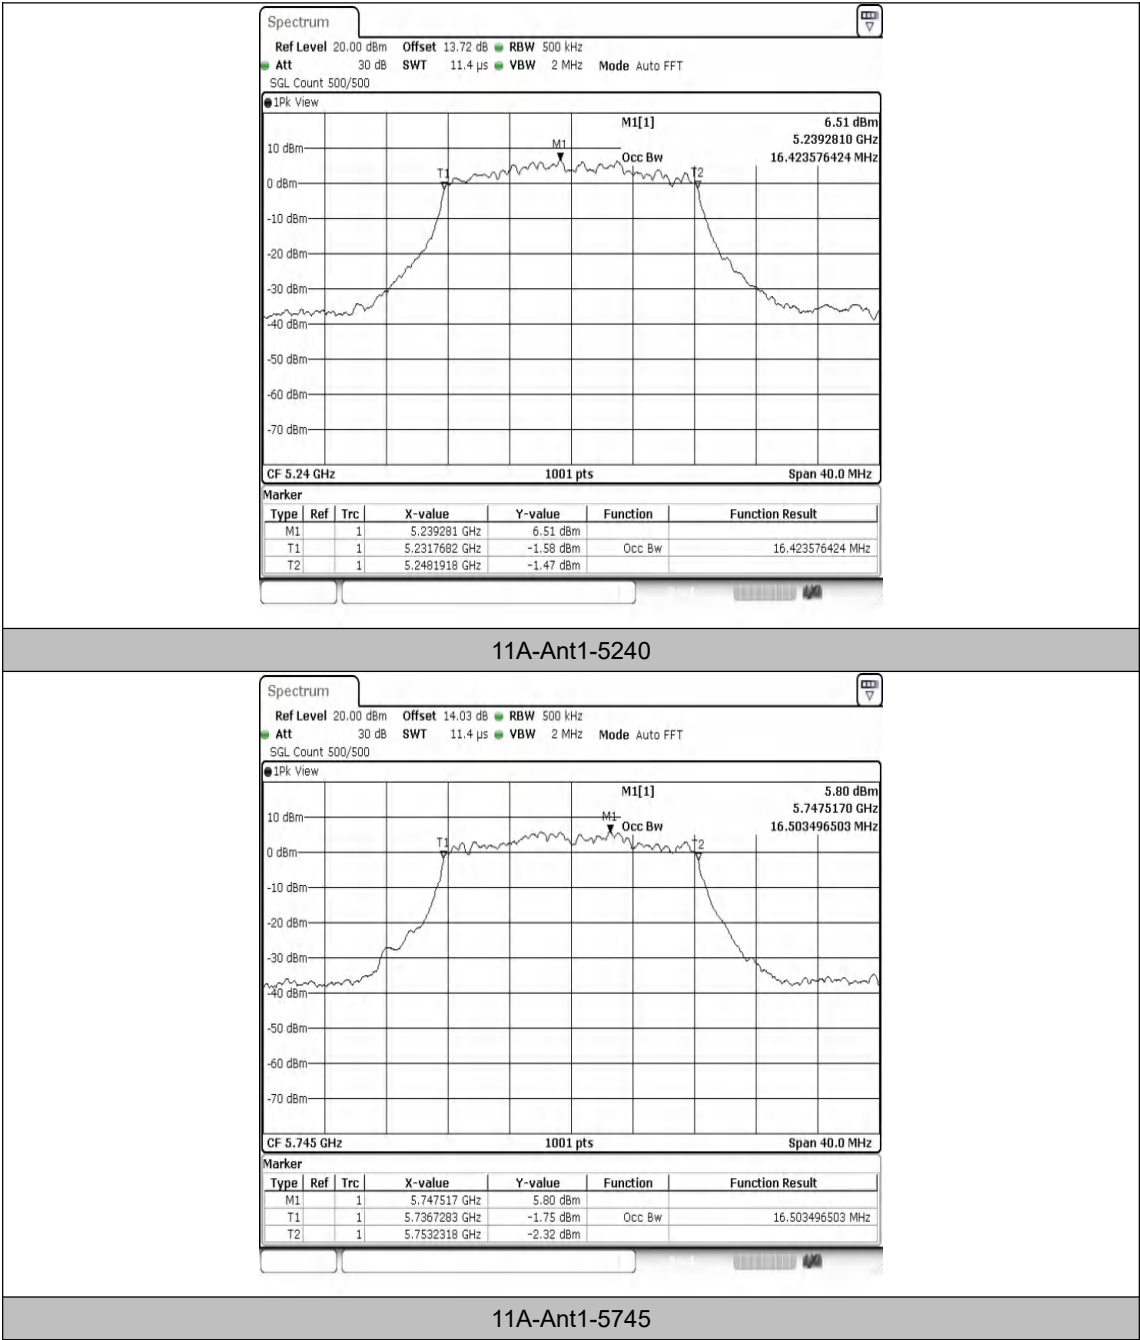

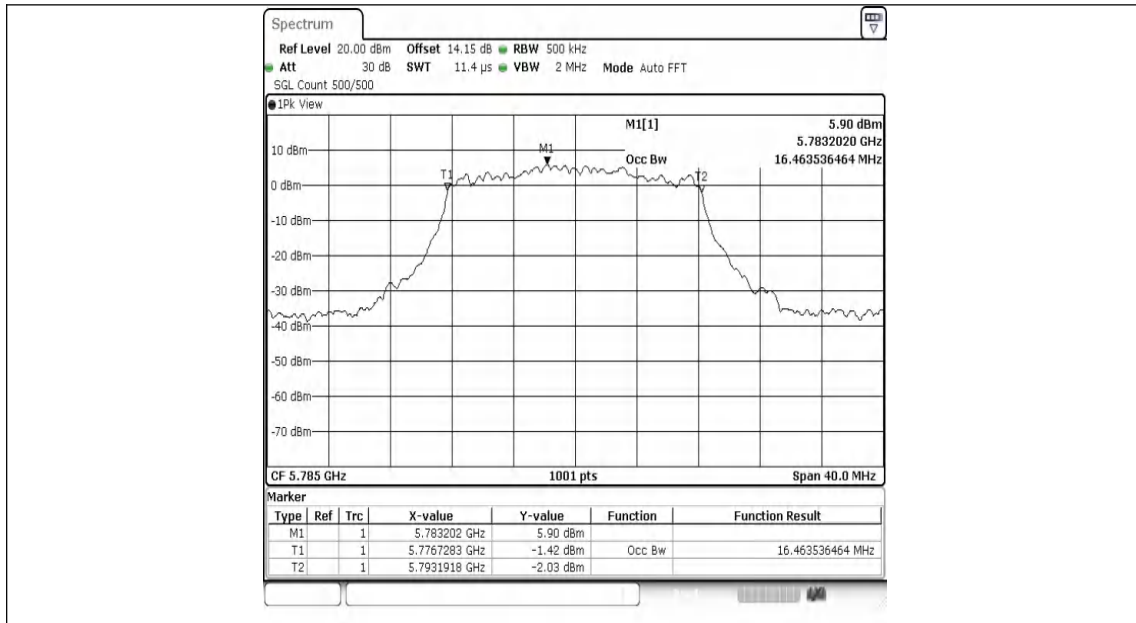



11A-Ant1-5785

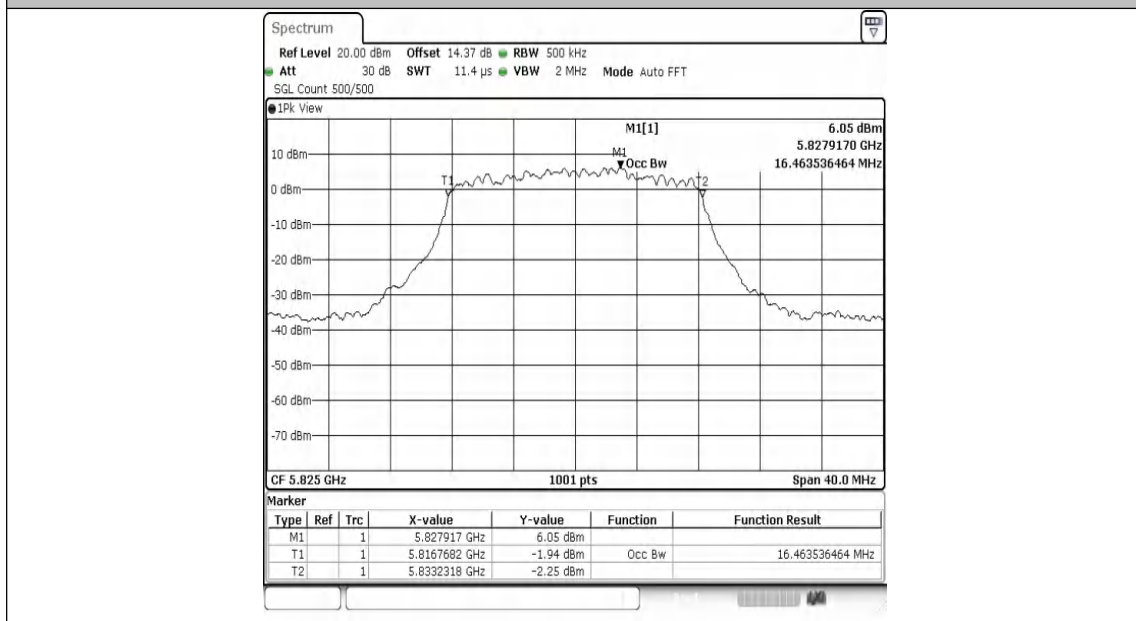


11A-Ant1-5825




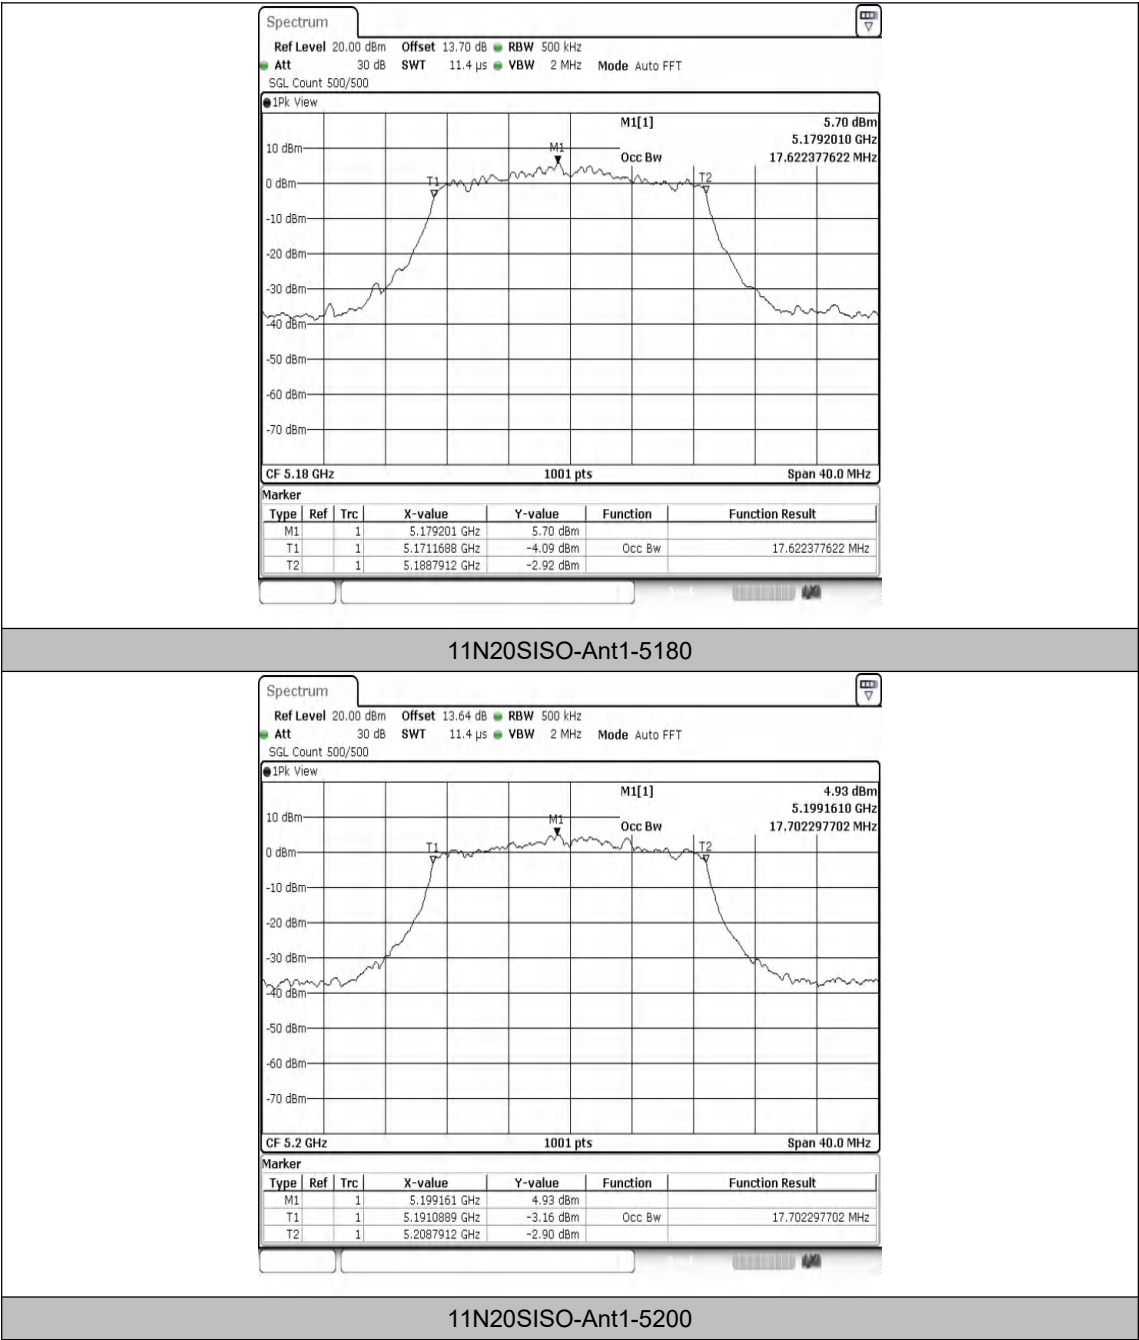

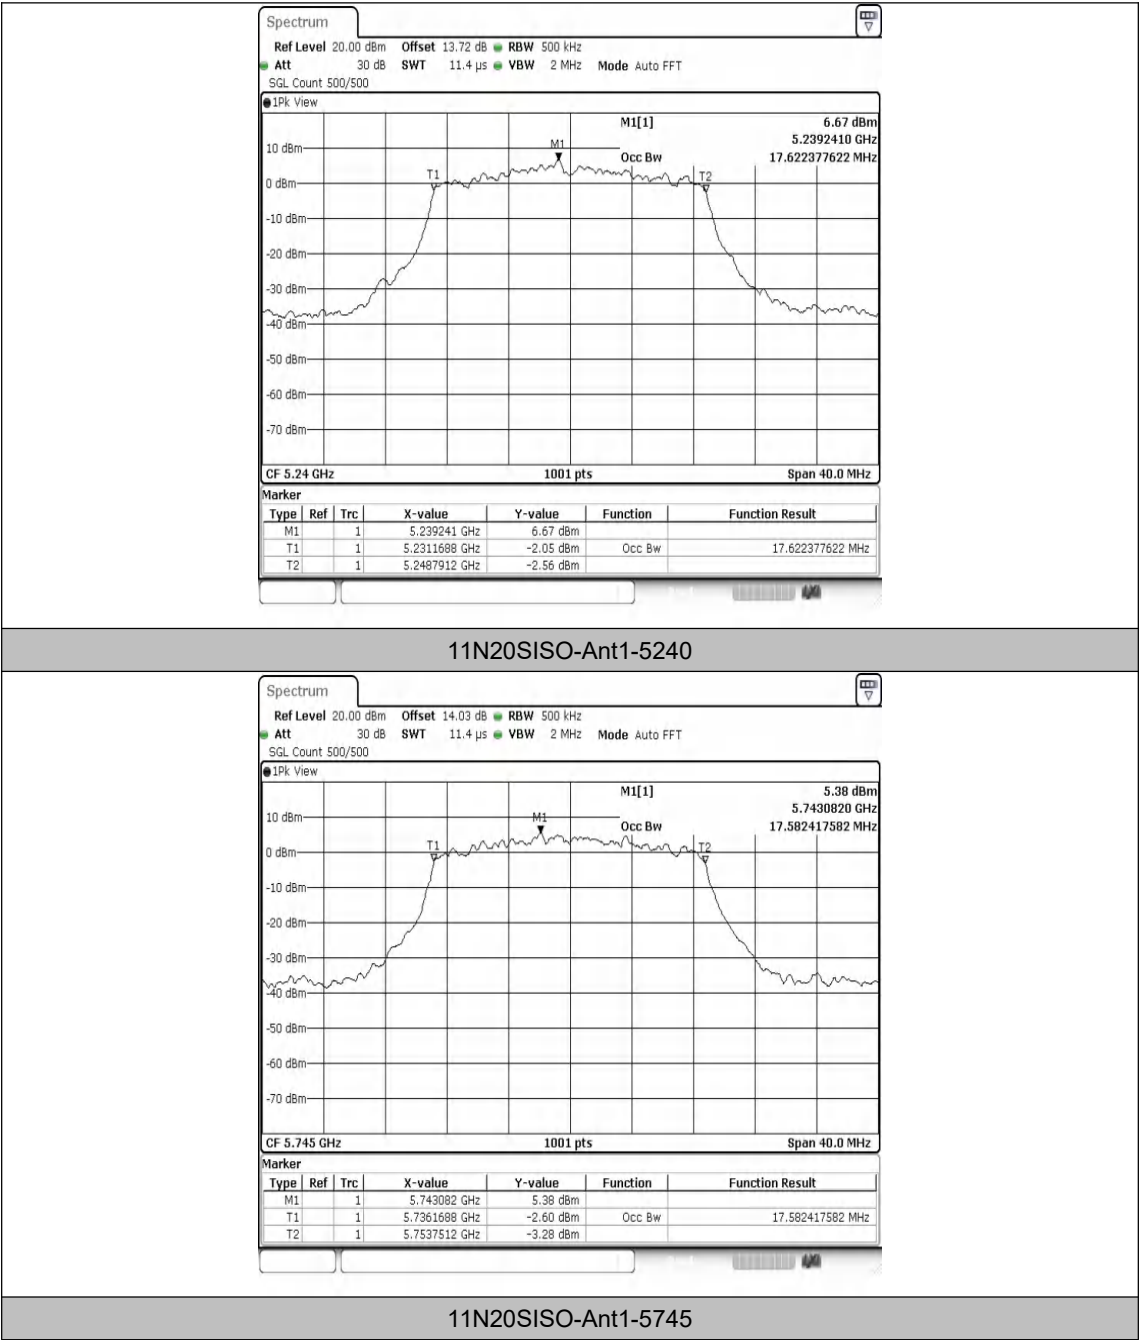

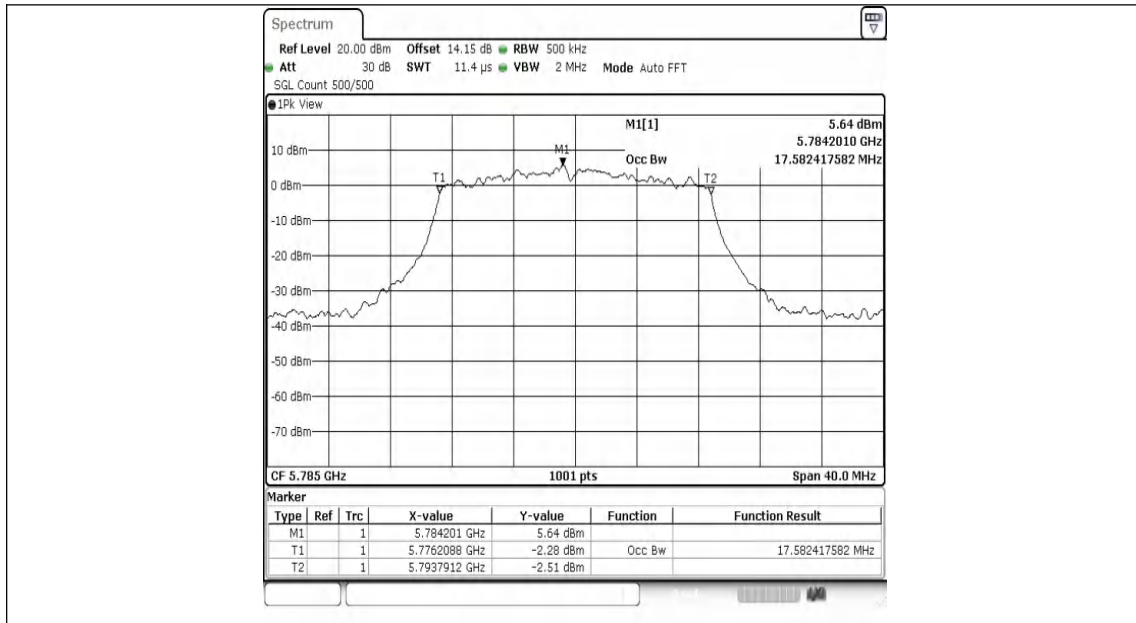



11N20SISO-Ant1-5785

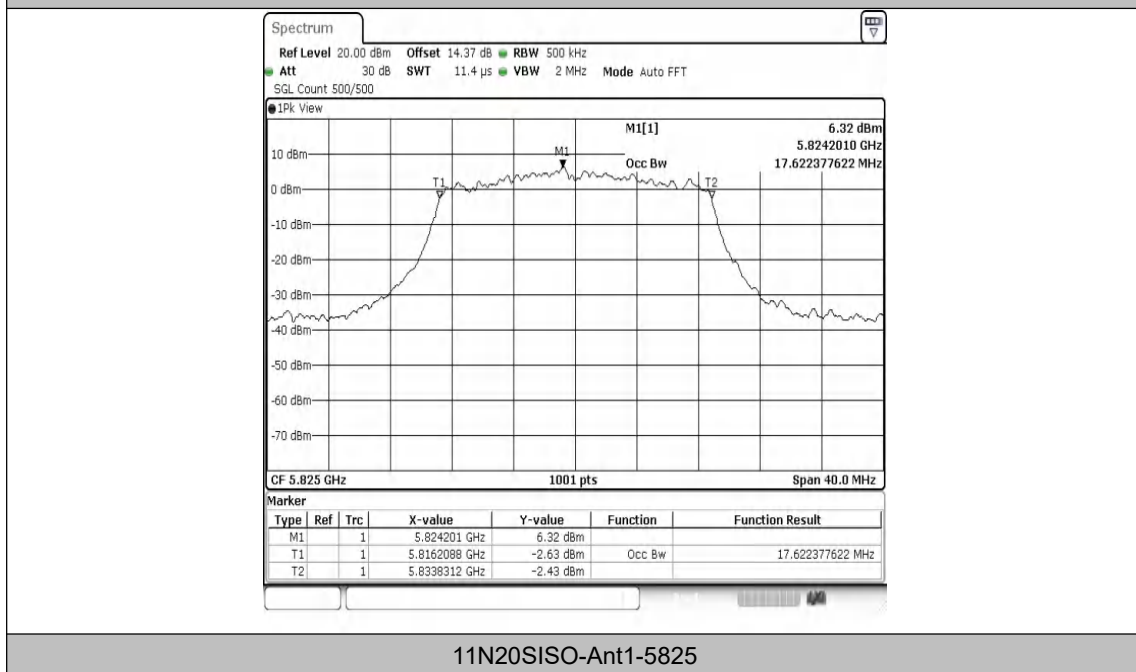


11N20SISO-Ant1-5825




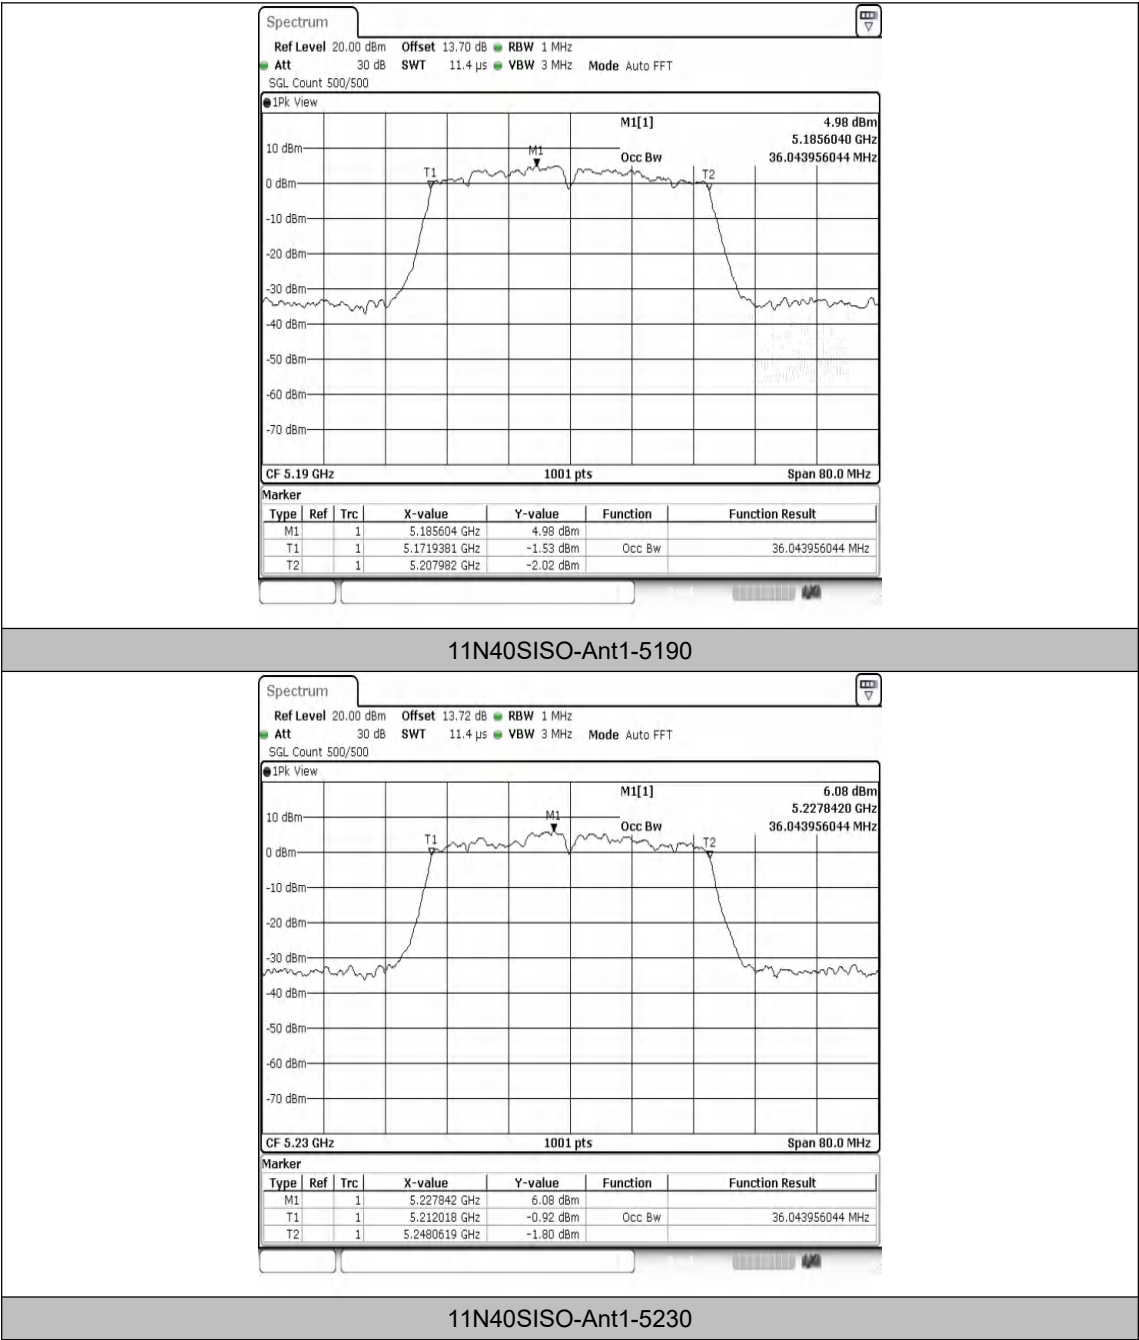

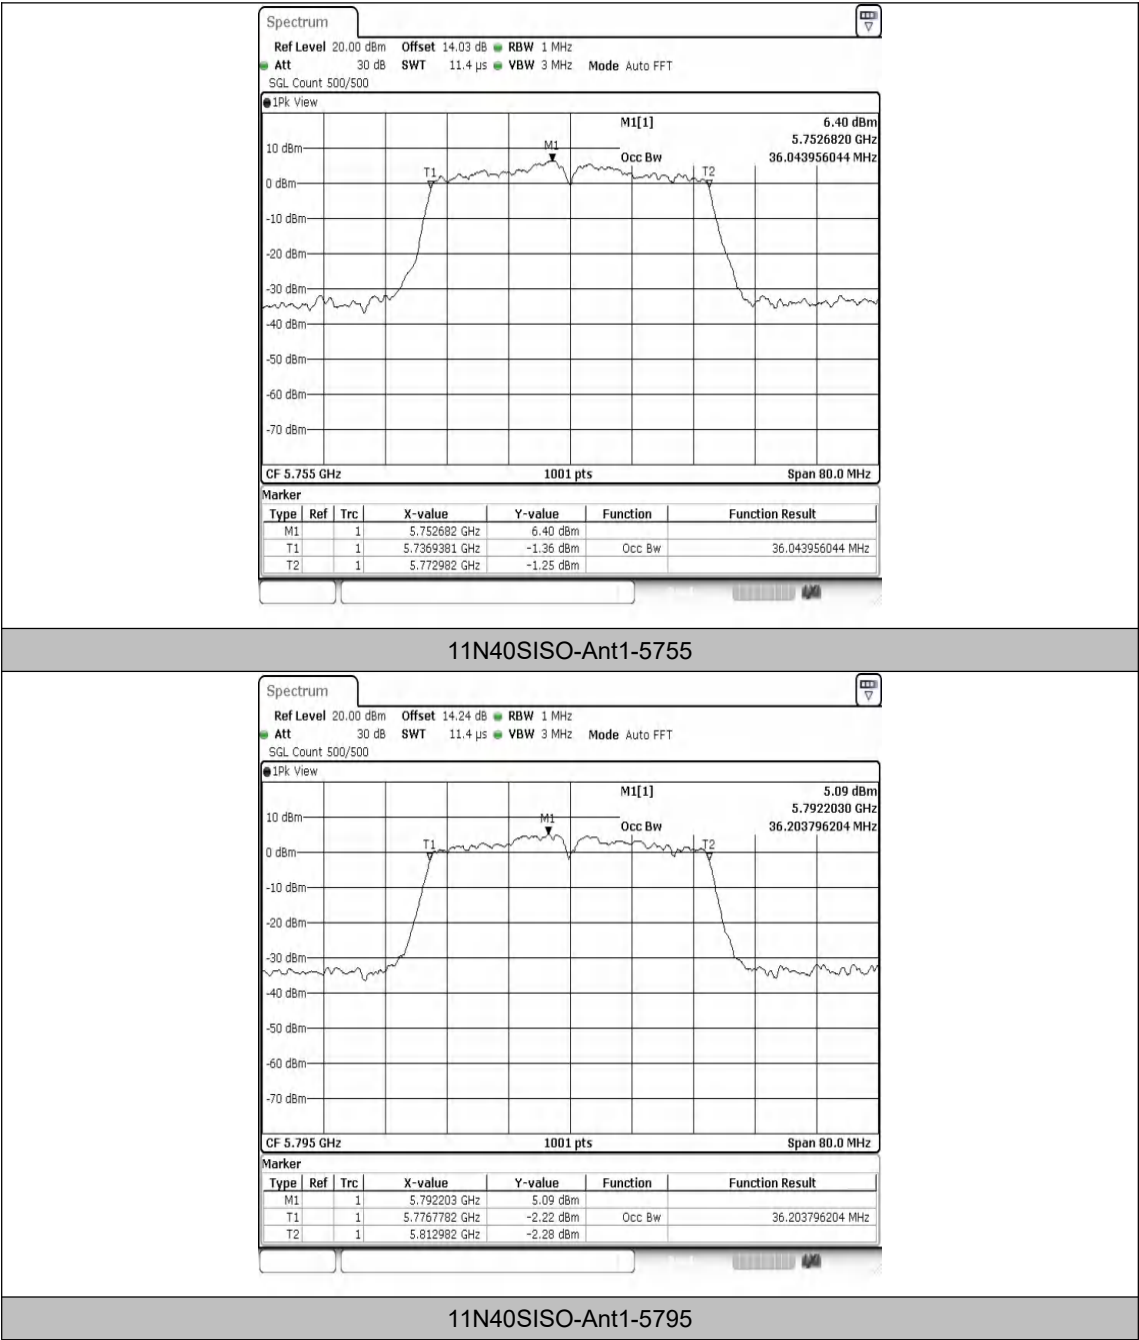

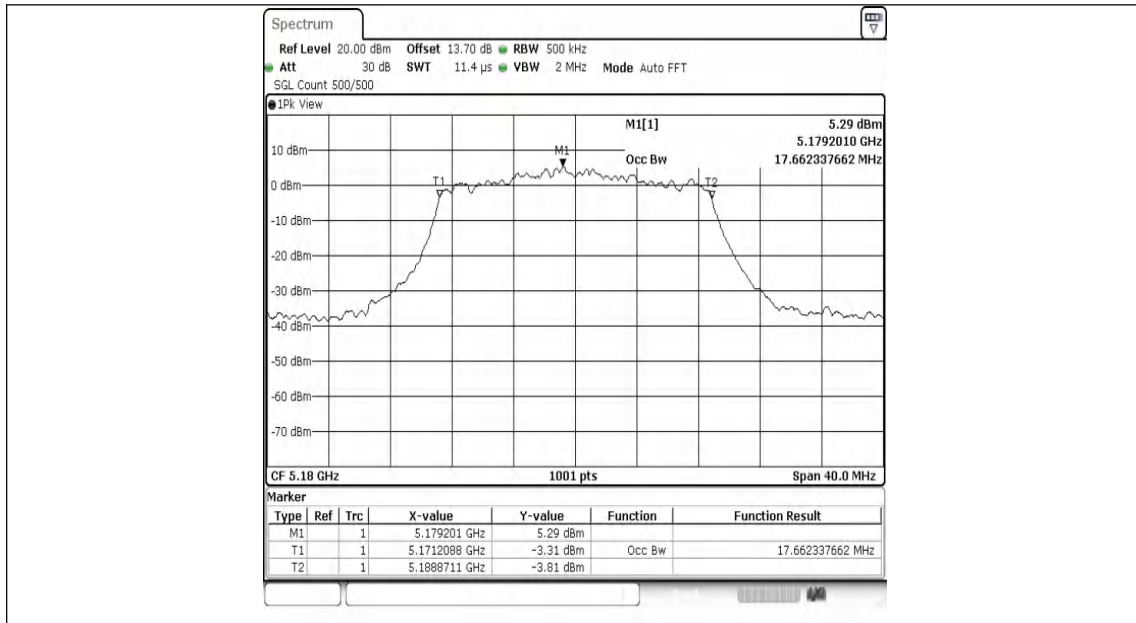



11AC20SISO-Ant1-5180

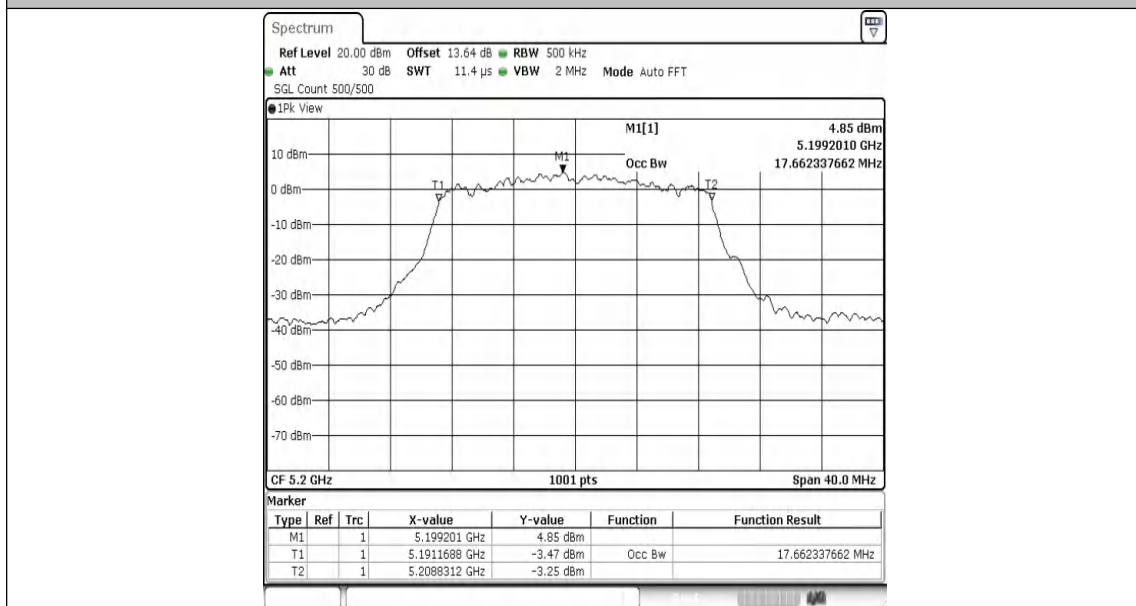



11AC20SISO-Ant1-5200




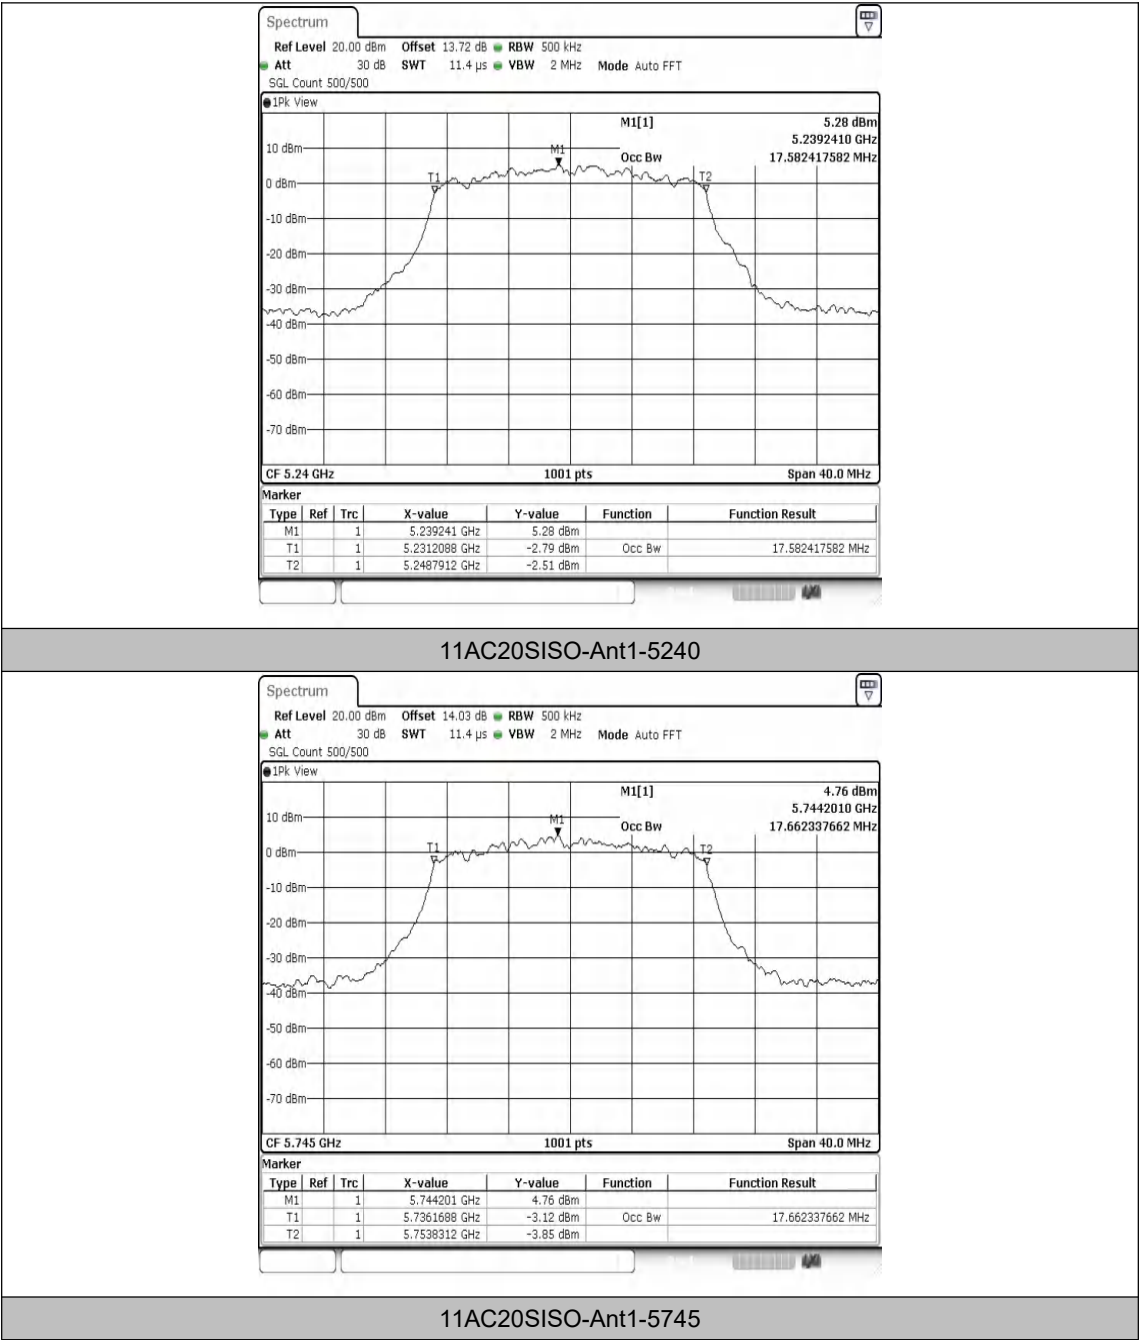

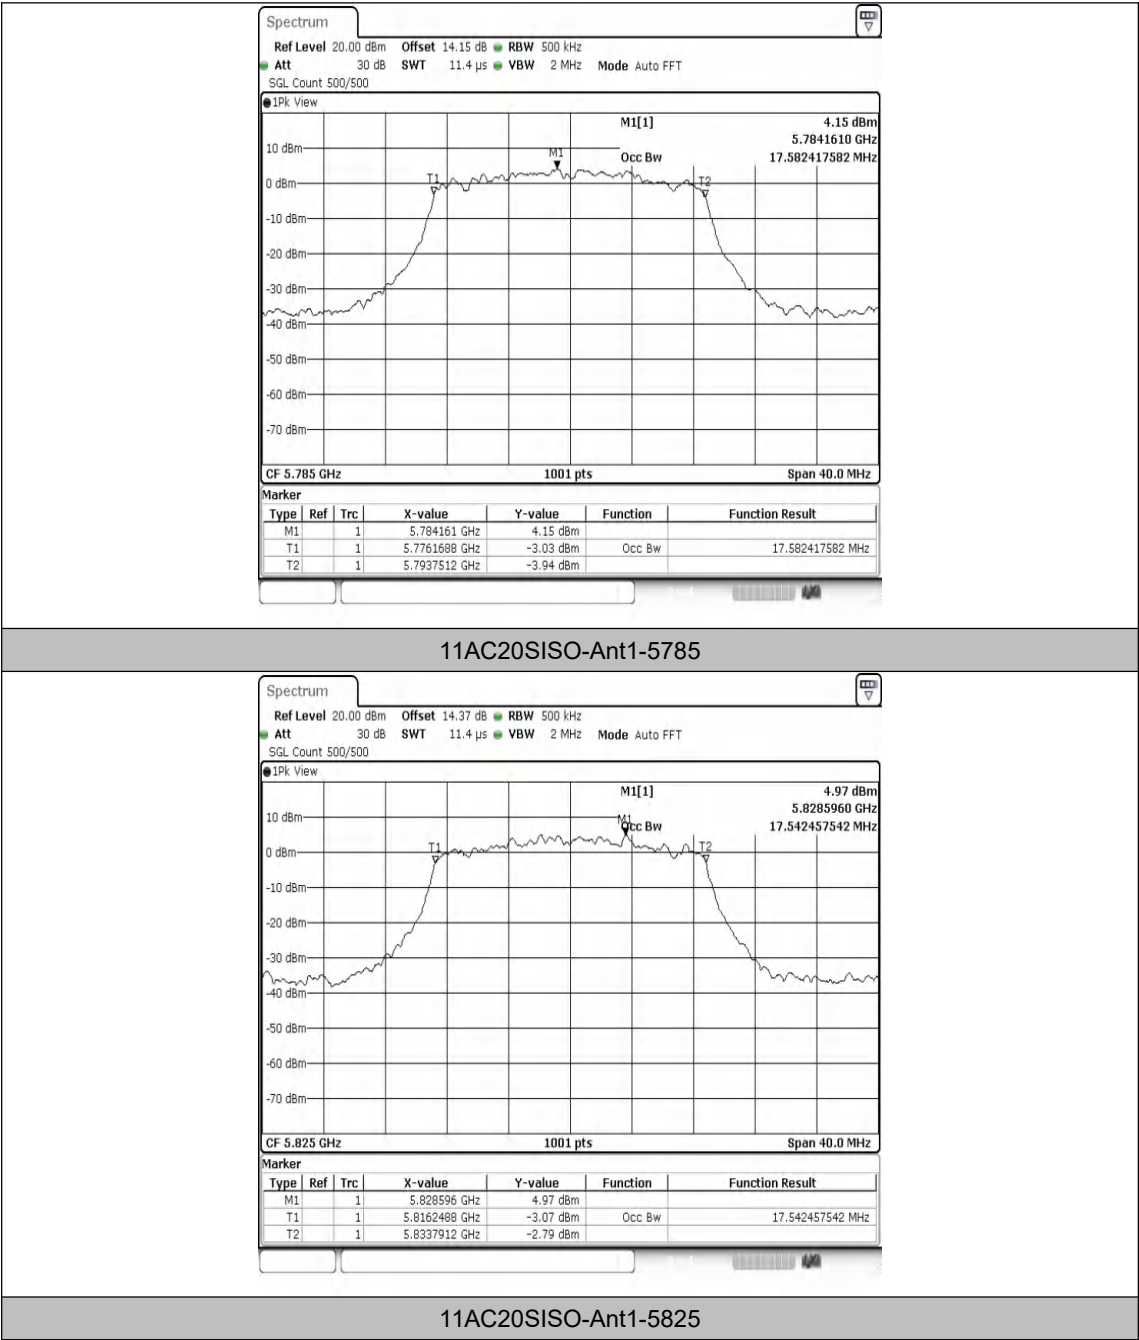

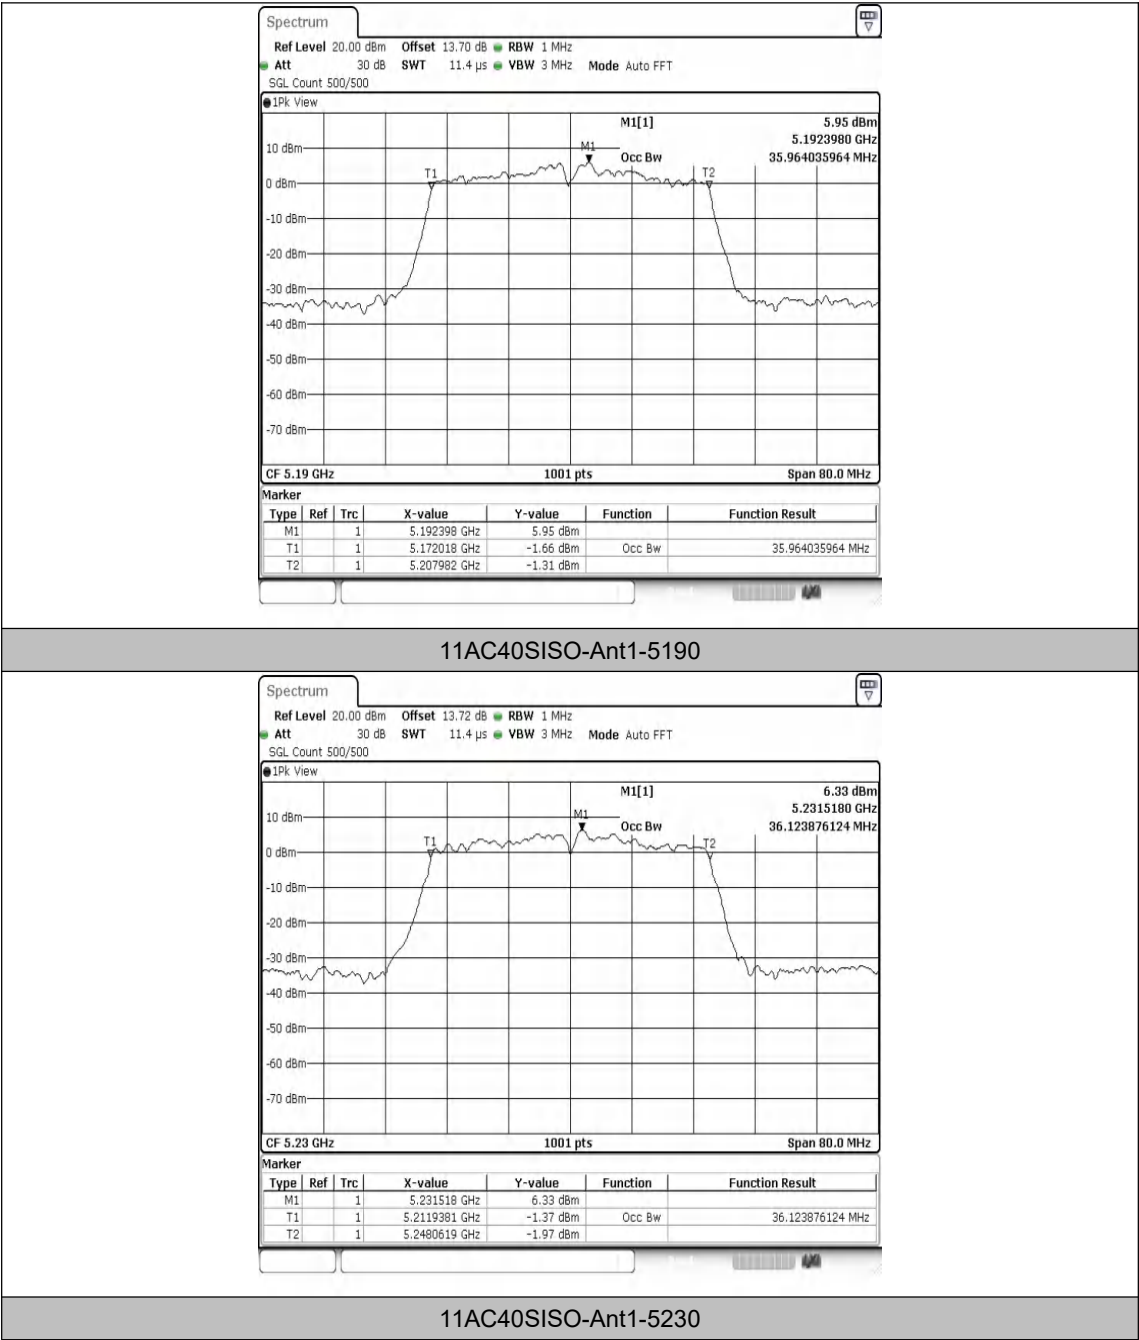

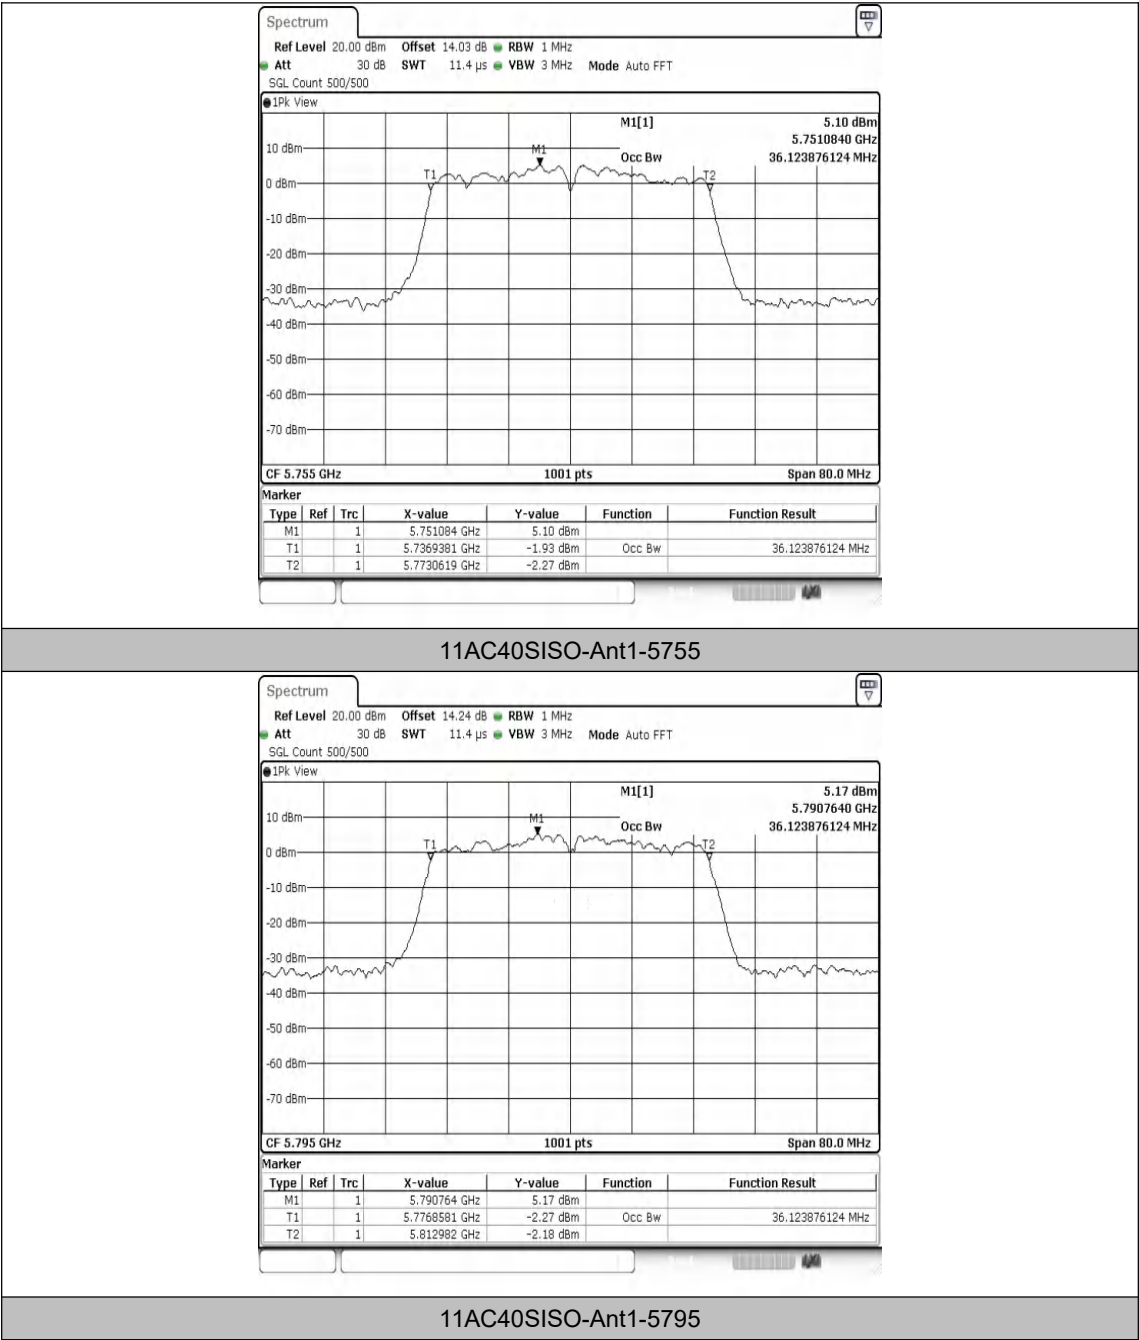

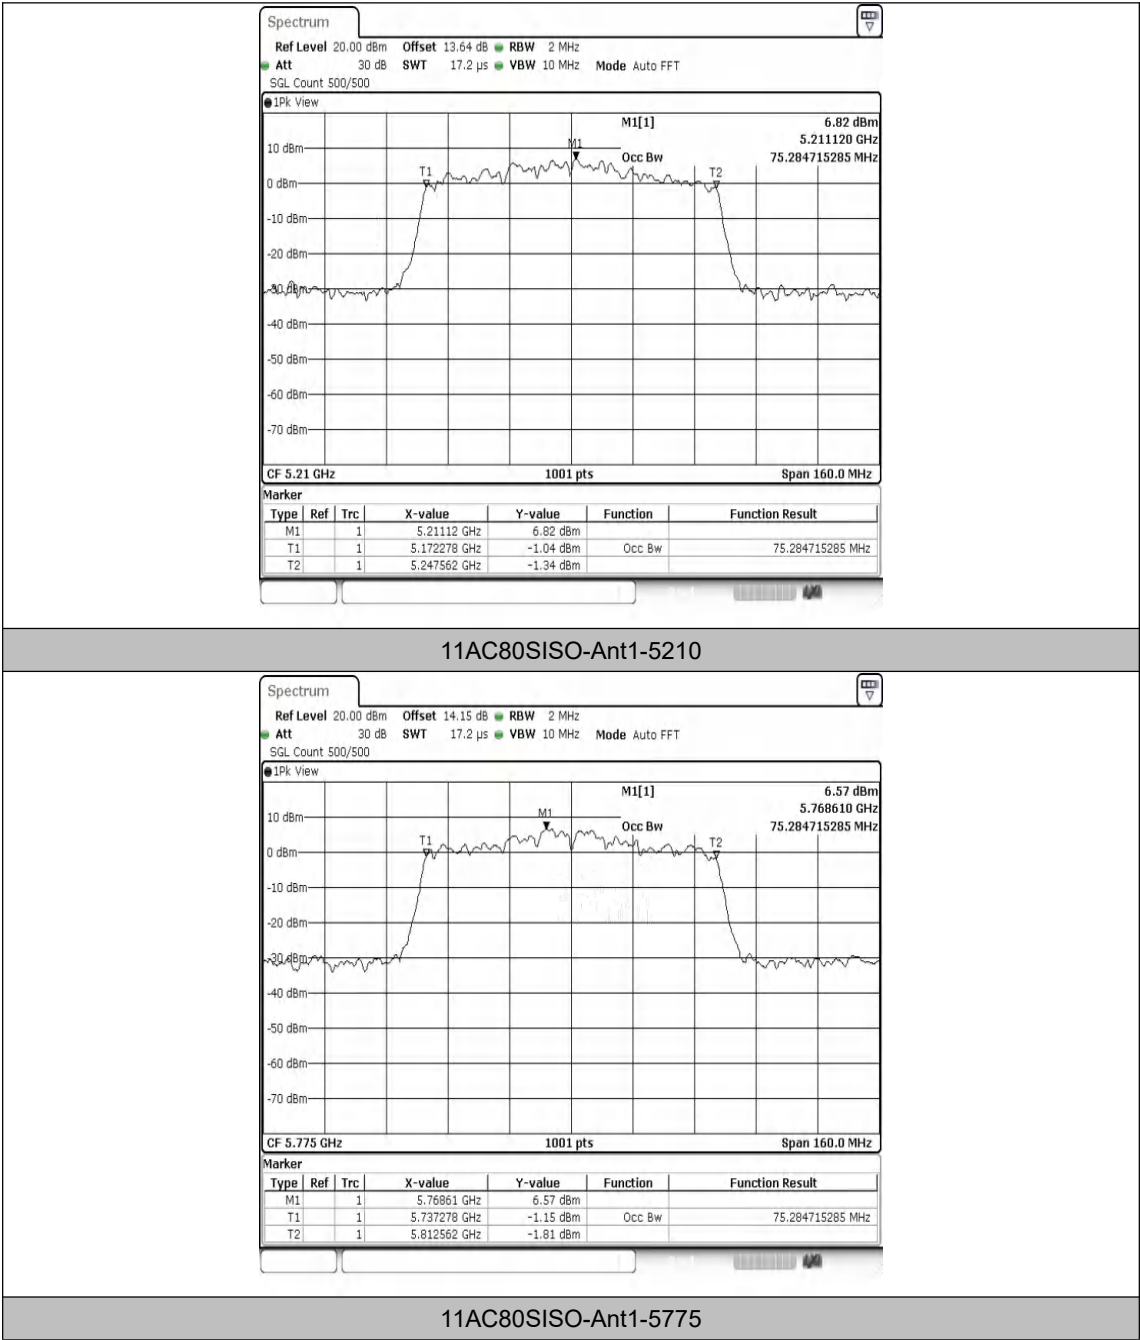


Appendix A3: Min emission bandwidth


Test Result B4

TestMode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.32	5736.80	5753.12	0.5	PASS
11A	Ant1	5785	15.80	5777.08	5792.88	0.5	PASS
11A	Ant1	5825	16.32	5816.80	5833.12	0.5	PASS
11N20SISO	Ant1	5745	17.52	5736.20	5753.72	0.5	PASS
11N20SISO	Ant1	5785	17.16	5776.20	5793.36	0.5	PASS
11N20SISO	Ant1	5825	17.56	5816.20	5833.76	0.5	PASS
11N40SISO	Ant1	5755	34.72	5737.16	5771.88	0.5	PASS
11N40SISO	Ant1	5795	26.88	5779.96	5806.84	0.5	PASS
11AC20SISO	Ant1	5745	17.56	5736.20	5753.76	0.5	PASS
11AC20SISO	Ant1	5785	17.56	5776.20	5793.76	0.5	PASS
11AC20SISO	Ant1	5825	17.56	5816.20	5833.76	0.5	PASS
11AC40SISO	Ant1	5755	36.40	5736.76	5773.16	0.5	PASS
11AC40SISO	Ant1	5795	36.32	5776.84	5813.16	0.5	PASS
11AC80SISO	Ant1	5775	62.72	5743.64	5806.36	0.5	PASS




Test Graphs B4

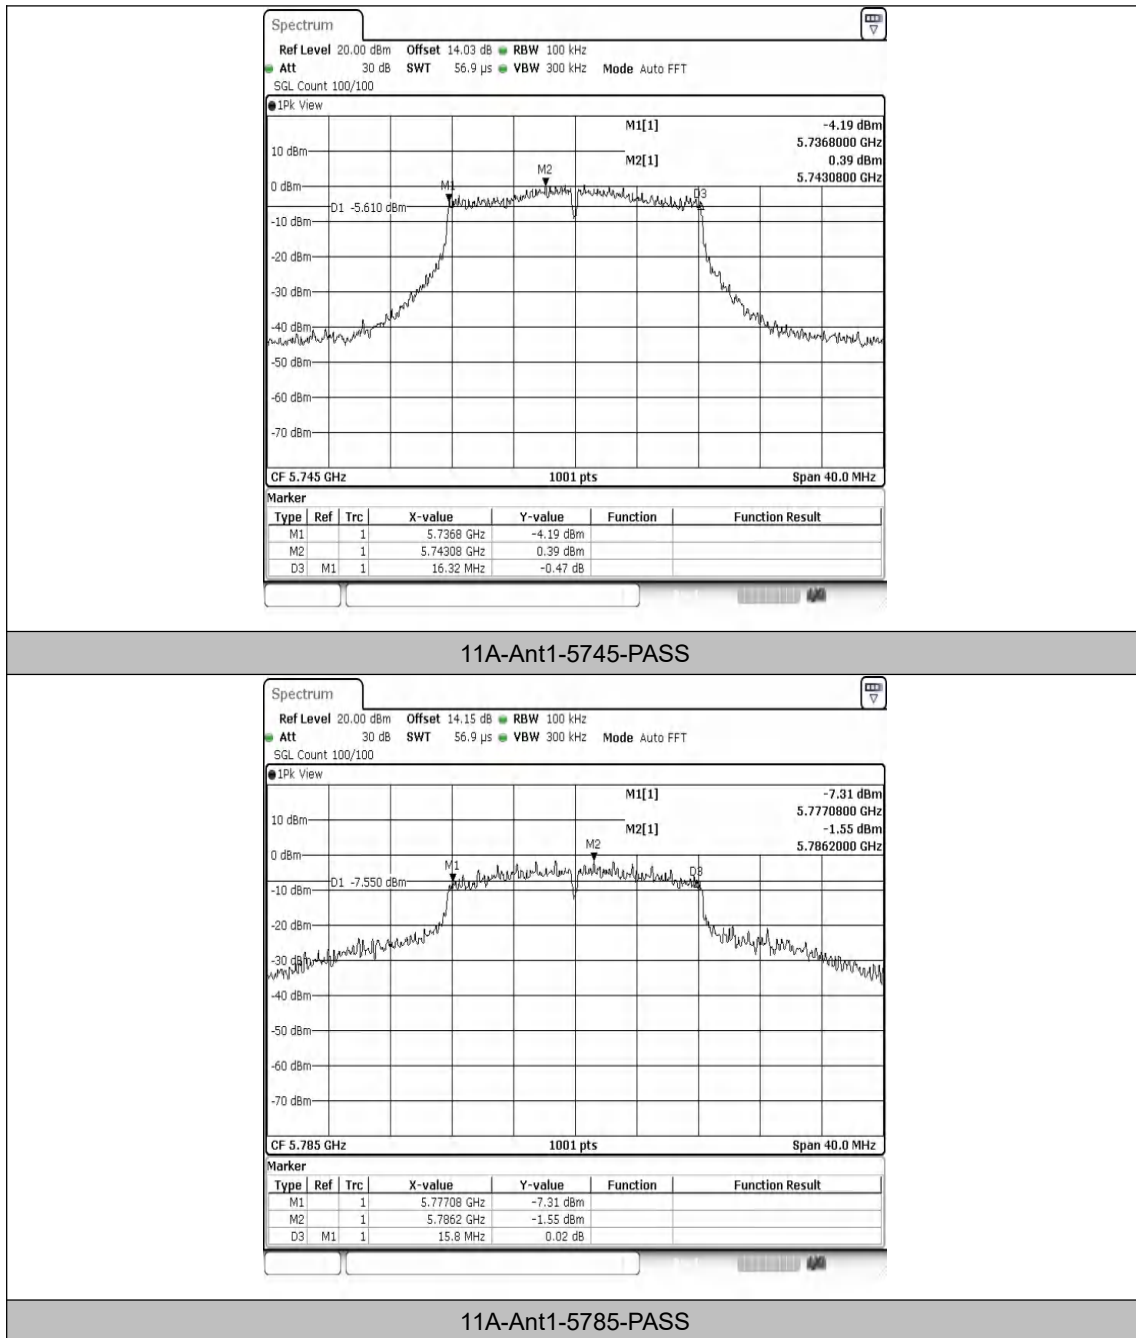

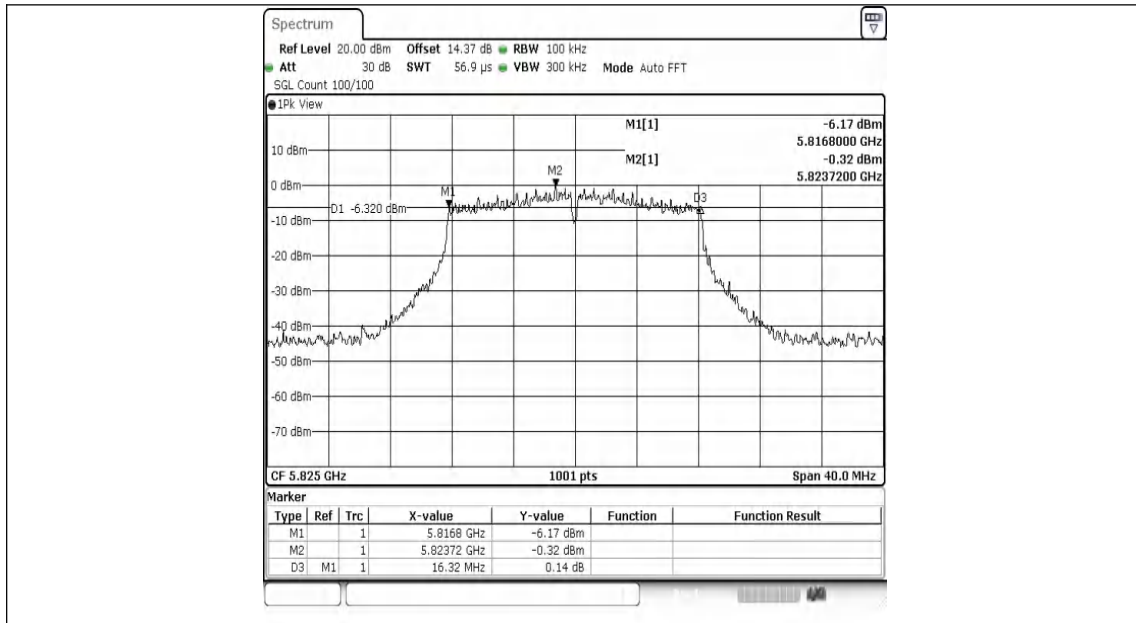


11A-Ant1-5825-PASS

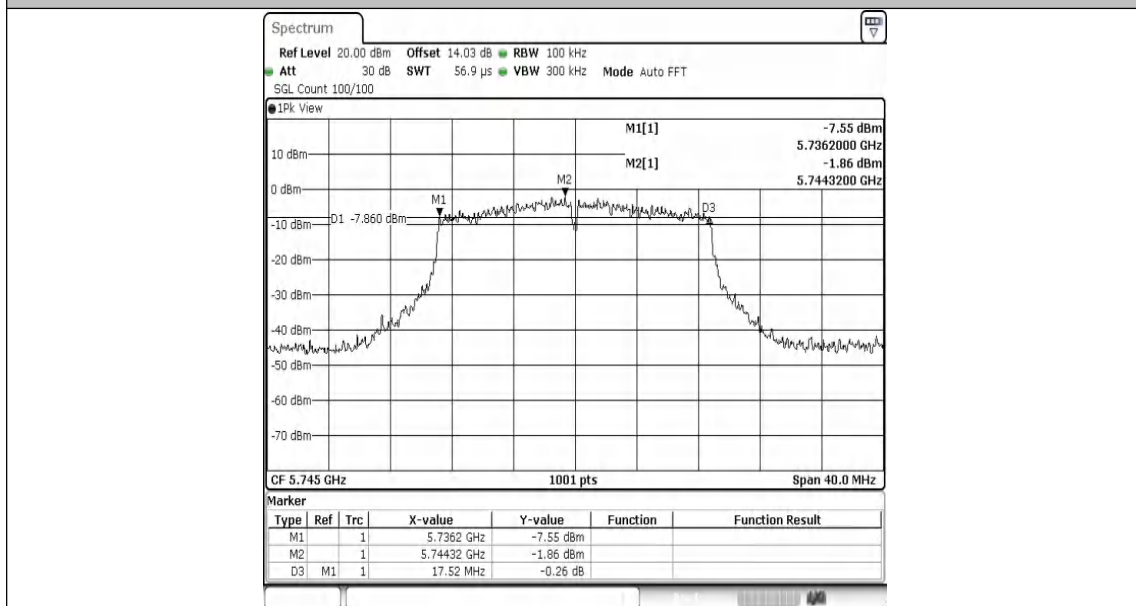


11N20SISO-Ant1-5745-PASS



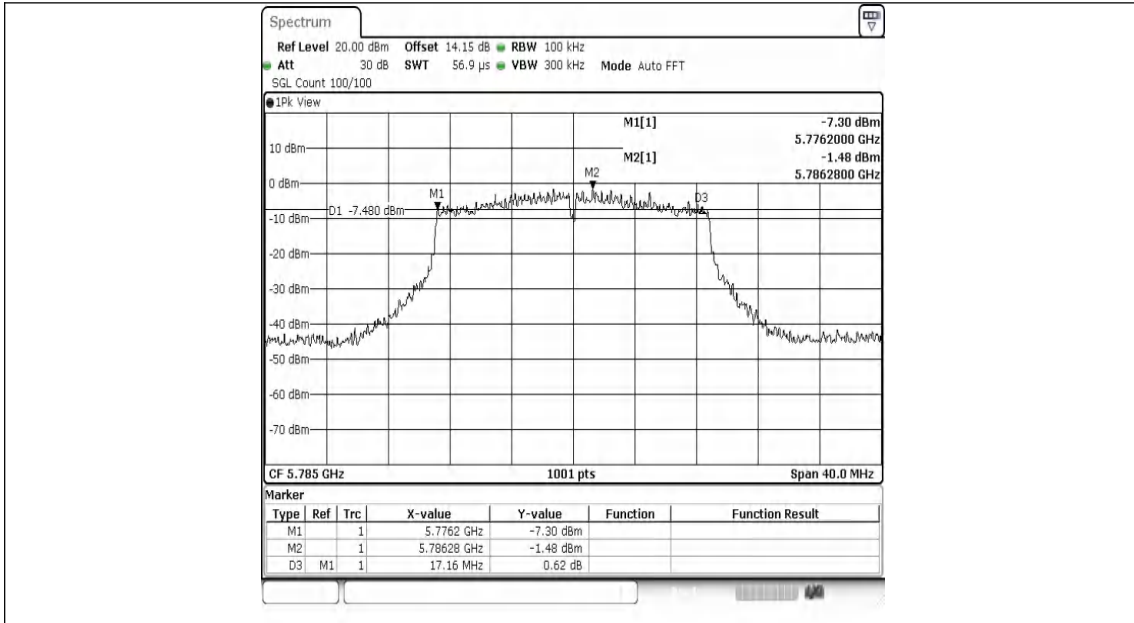


11N20ISO-Ant1-5785-PASS

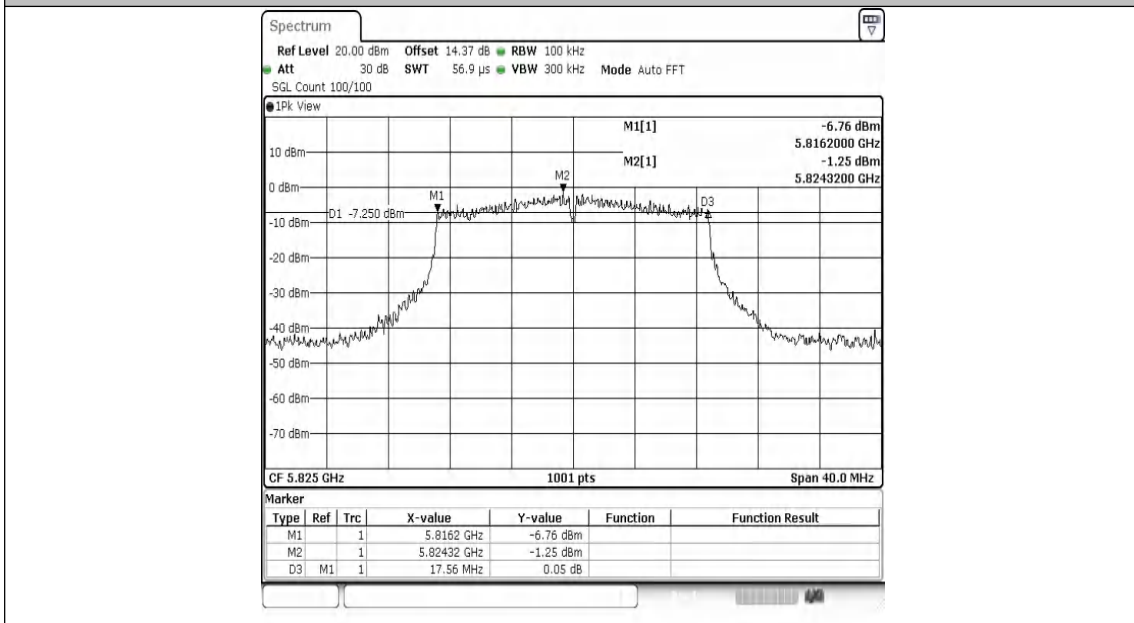


11N20ISO-Ant1-5825-PASS



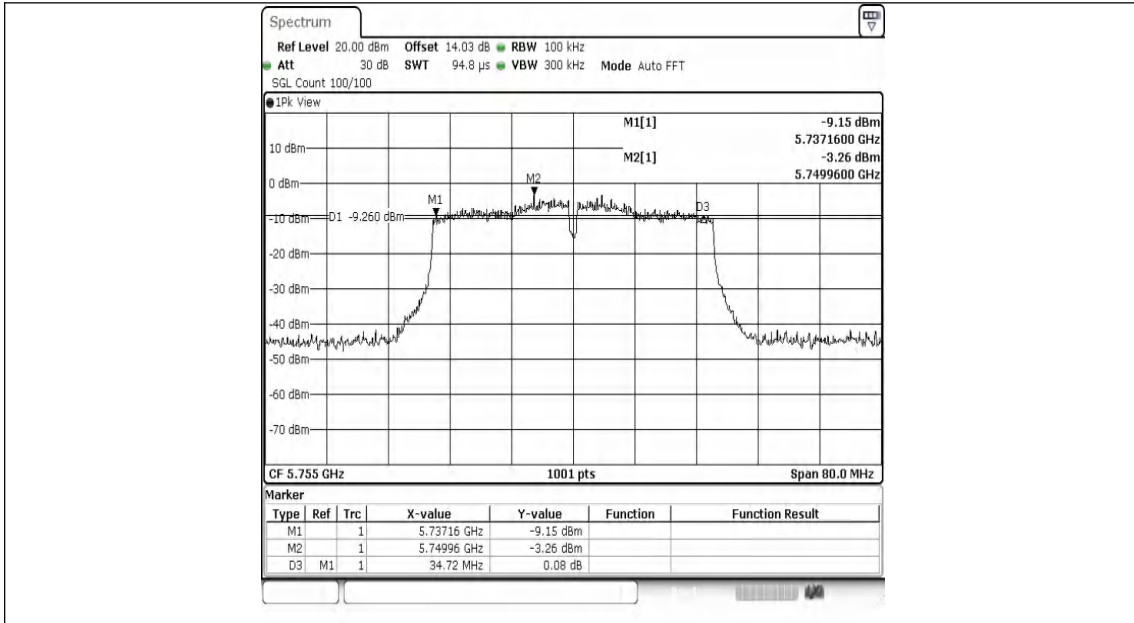



11N40ISO-Ant1-5755-PASS

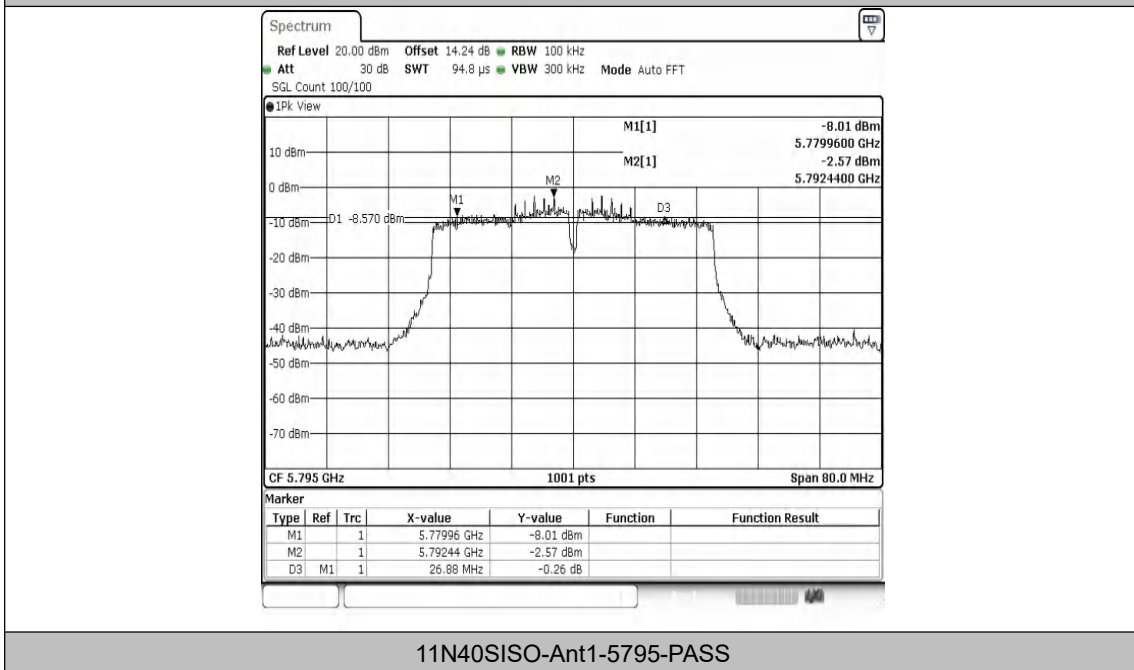


11N40ISO-Ant1-5795-PASS



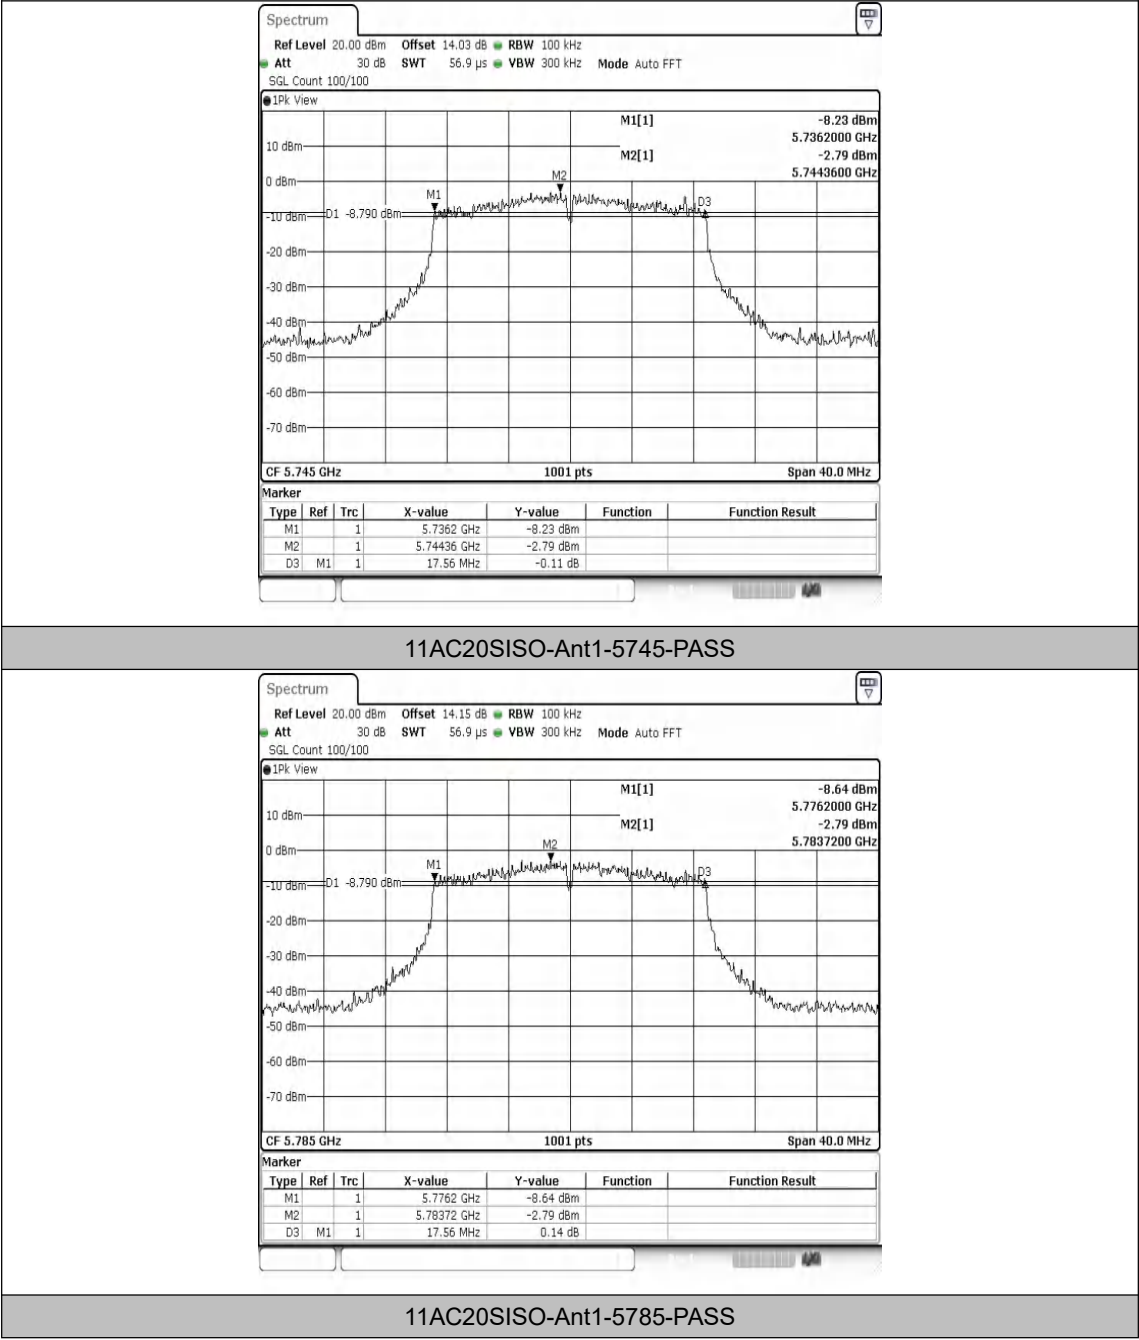

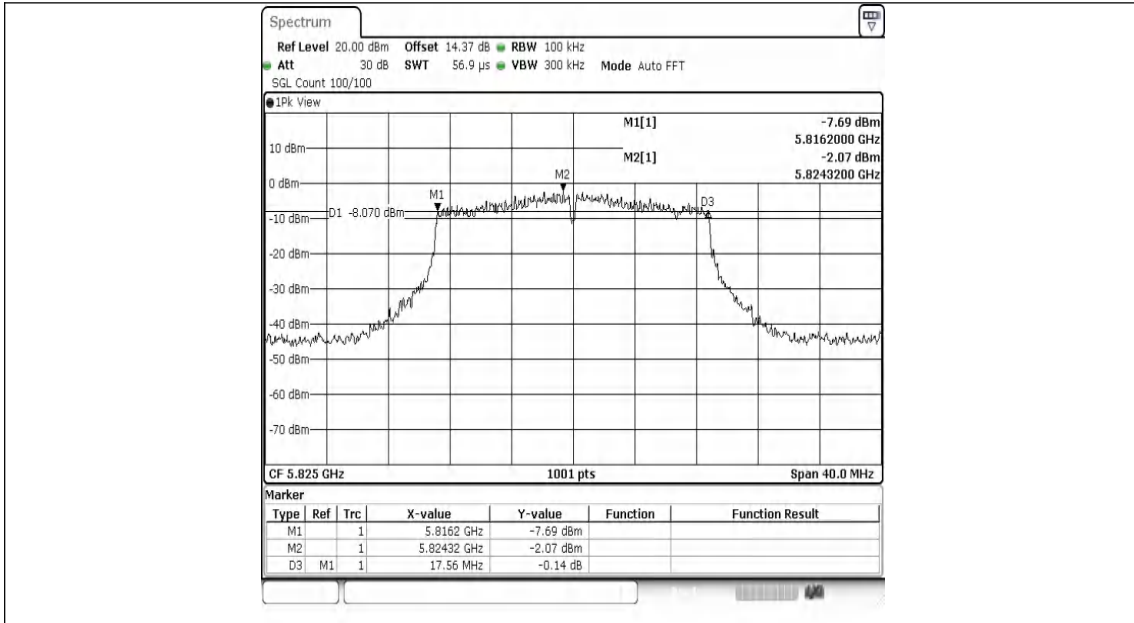


11AC20SISO-Ant1-5825-PASS

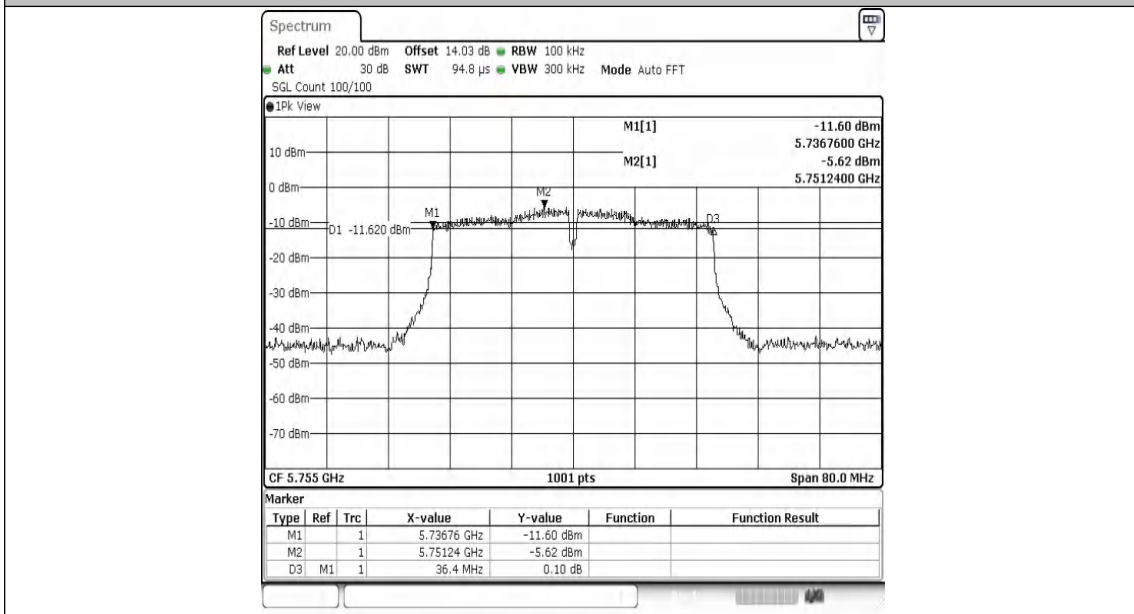

11AC40SISO-Ant1-5755-PASS



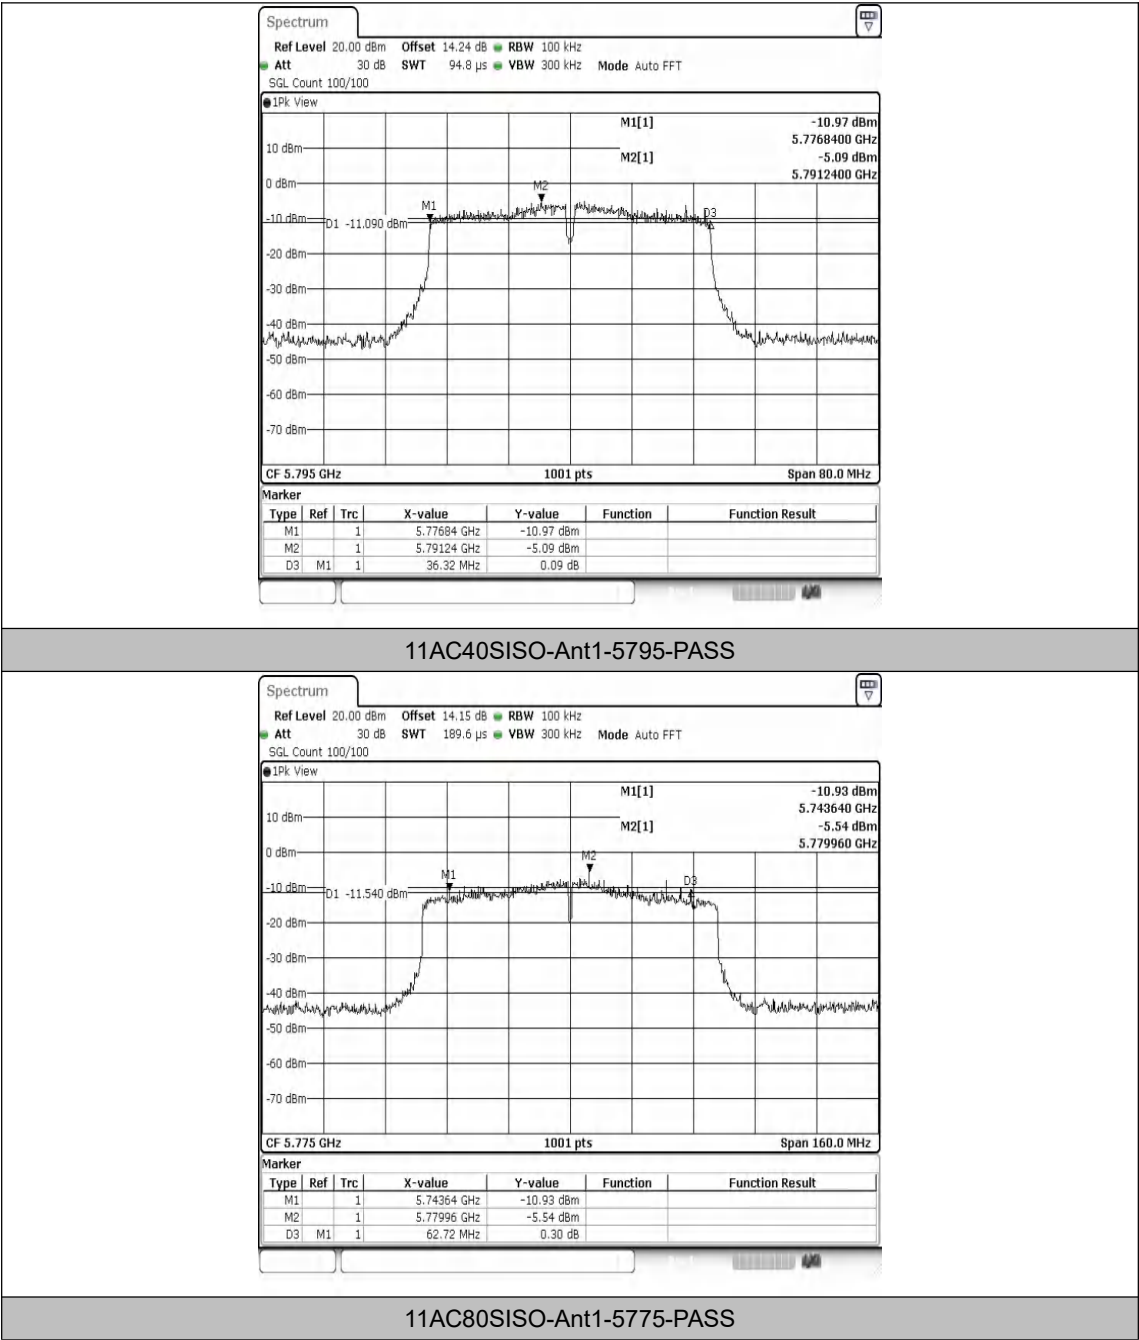


Appendix B: Duty Cycle

Test Result

TestMode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	4.21	4.23	99.53	0.02	0.24
11A	Ant1	5200	2.09	2.11	99.05	0.04	0.48
11A	Ant1	5240	2.09	2.11	99.05	0.04	0.48
11A	Ant1	5745	2.09	2.11	99.05	0.04	0.48
11A	Ant1	5785	4.21	4.23	99.53	0.02	0.24
11A	Ant1	5825	2.09	2.11	99.05	0.04	0.48
11N20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AC80SISO	Ant1	5210	100.00	100.00	100.00	0.00	0.01
11AC80SISO	Ant1	5775	100.00	100.00	100.00	0.00	0.01



Test Graphs

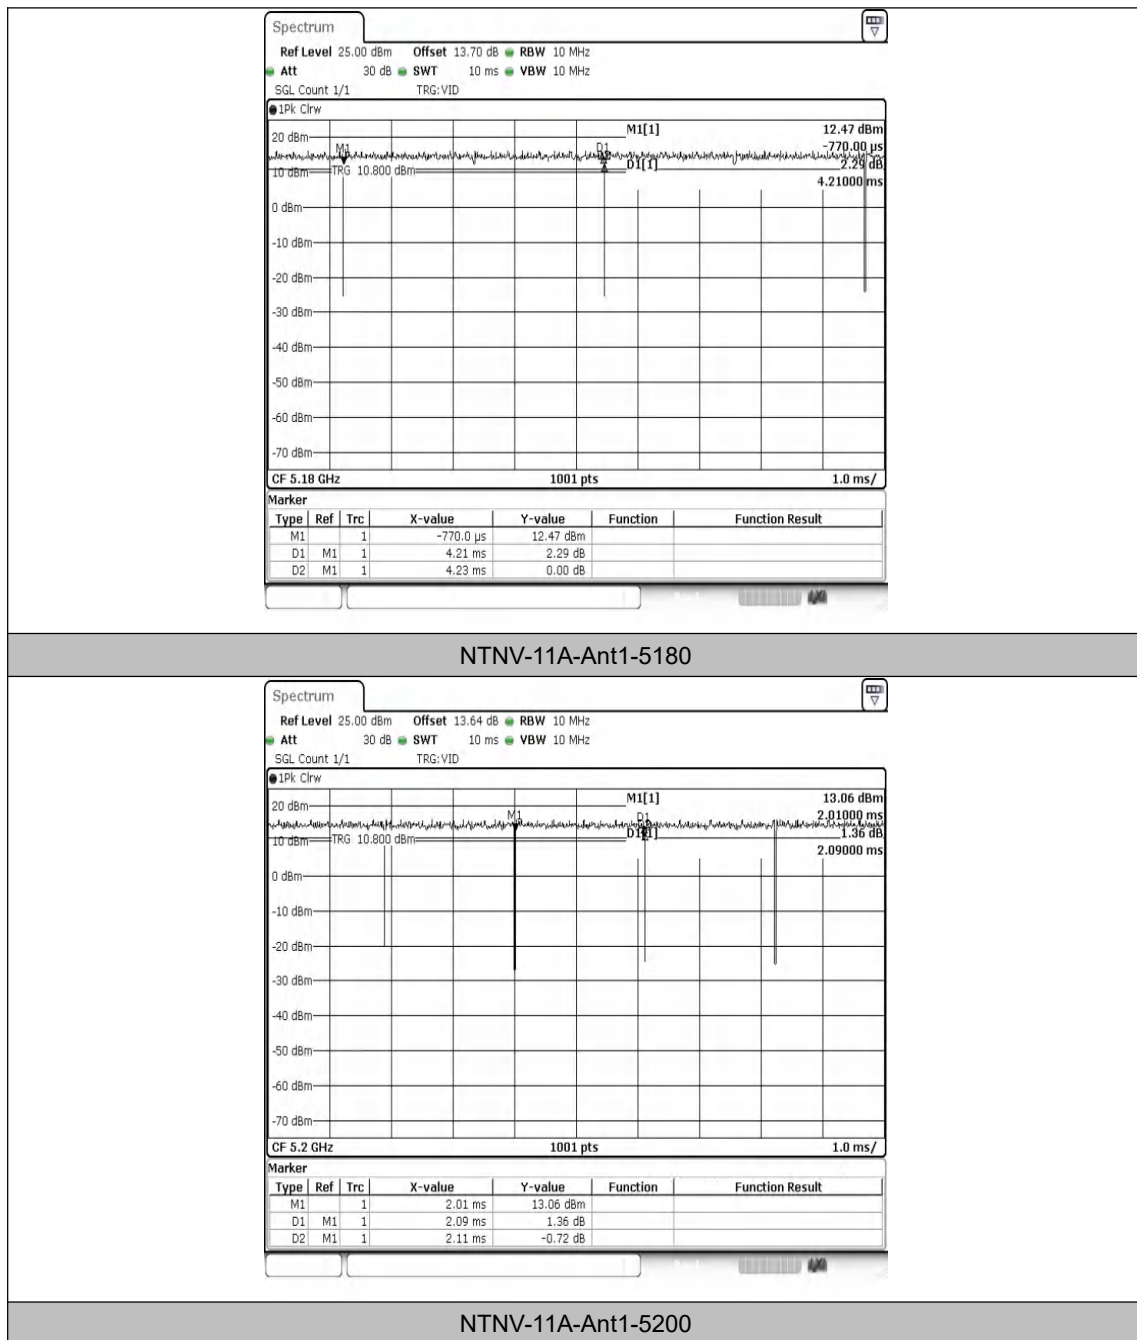


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



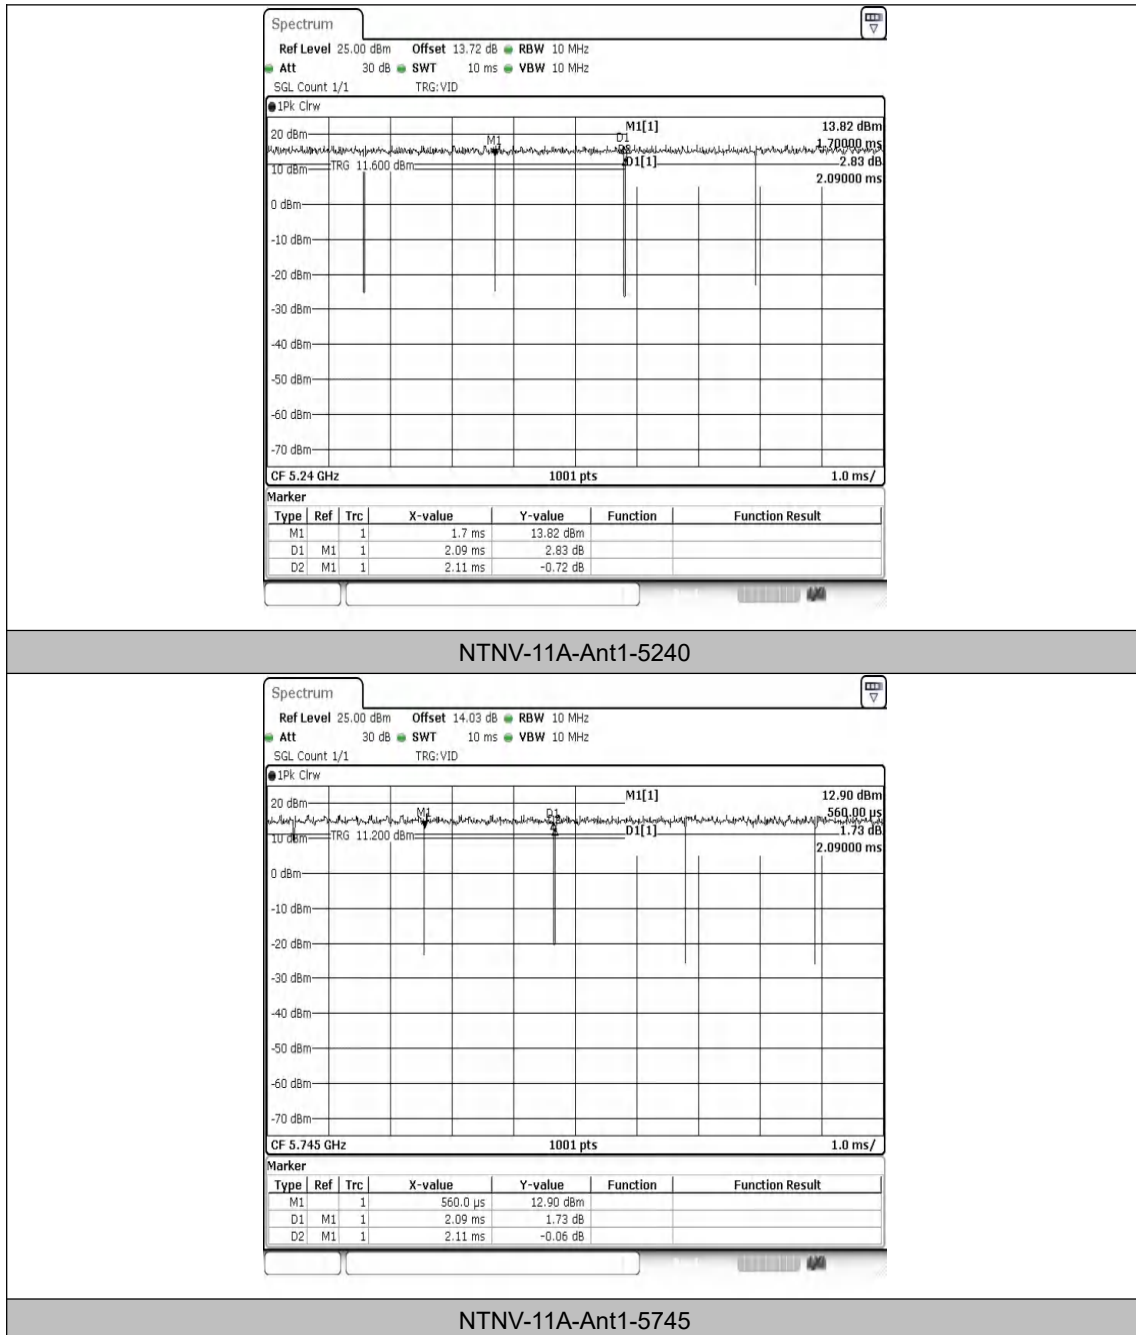


Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com





Hotline
400-003-0500
www.anbotech.com



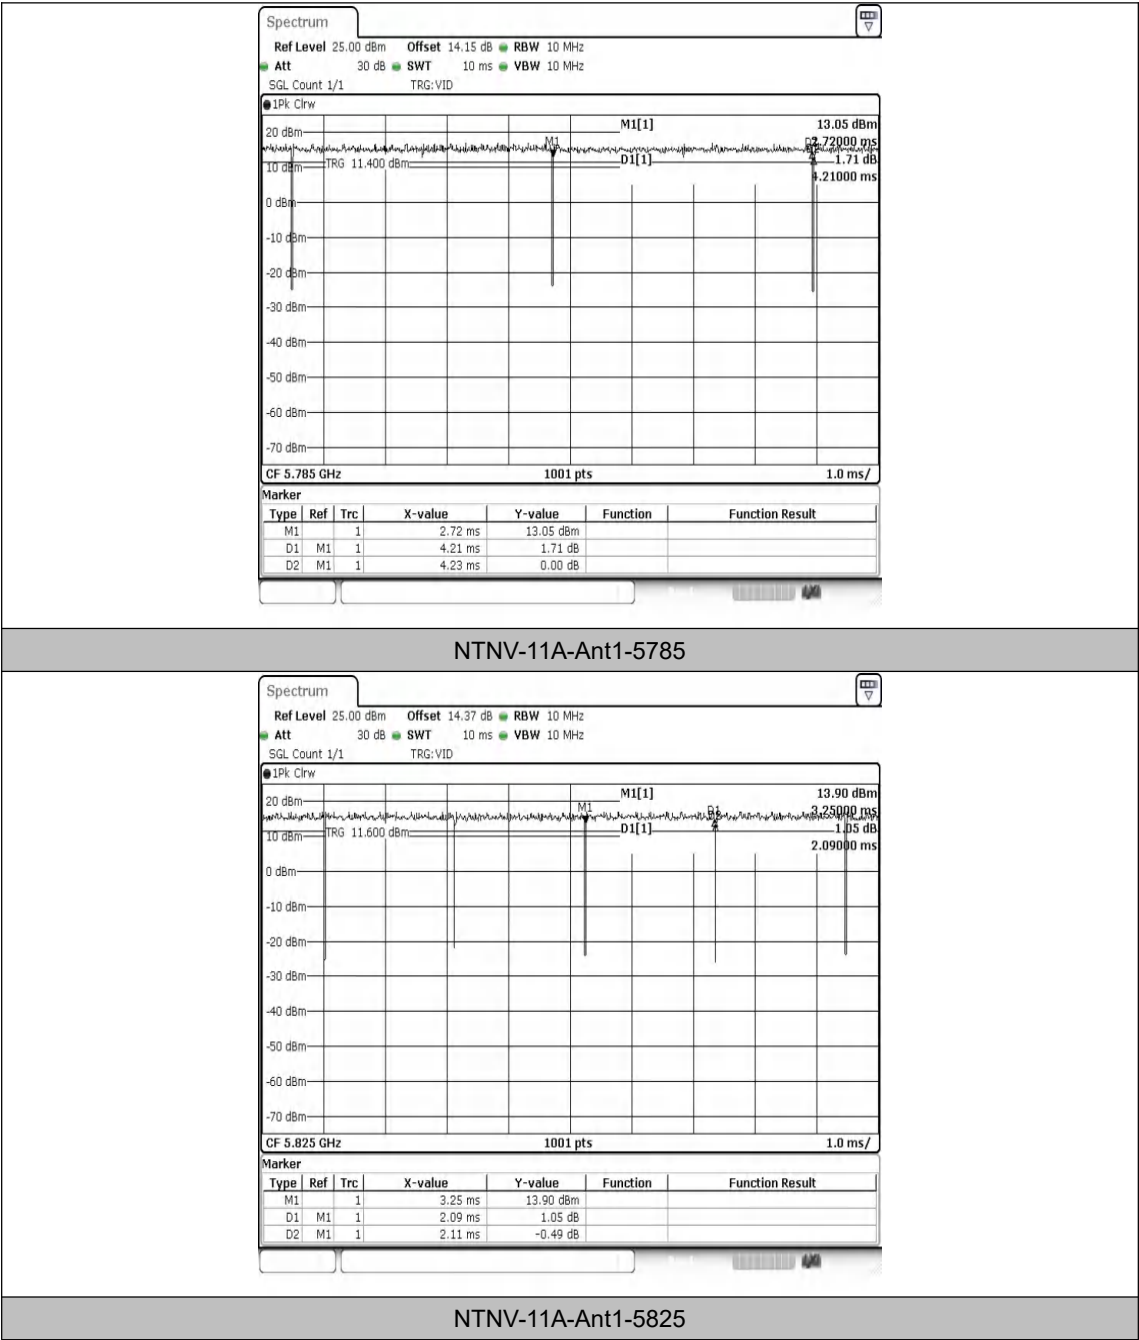

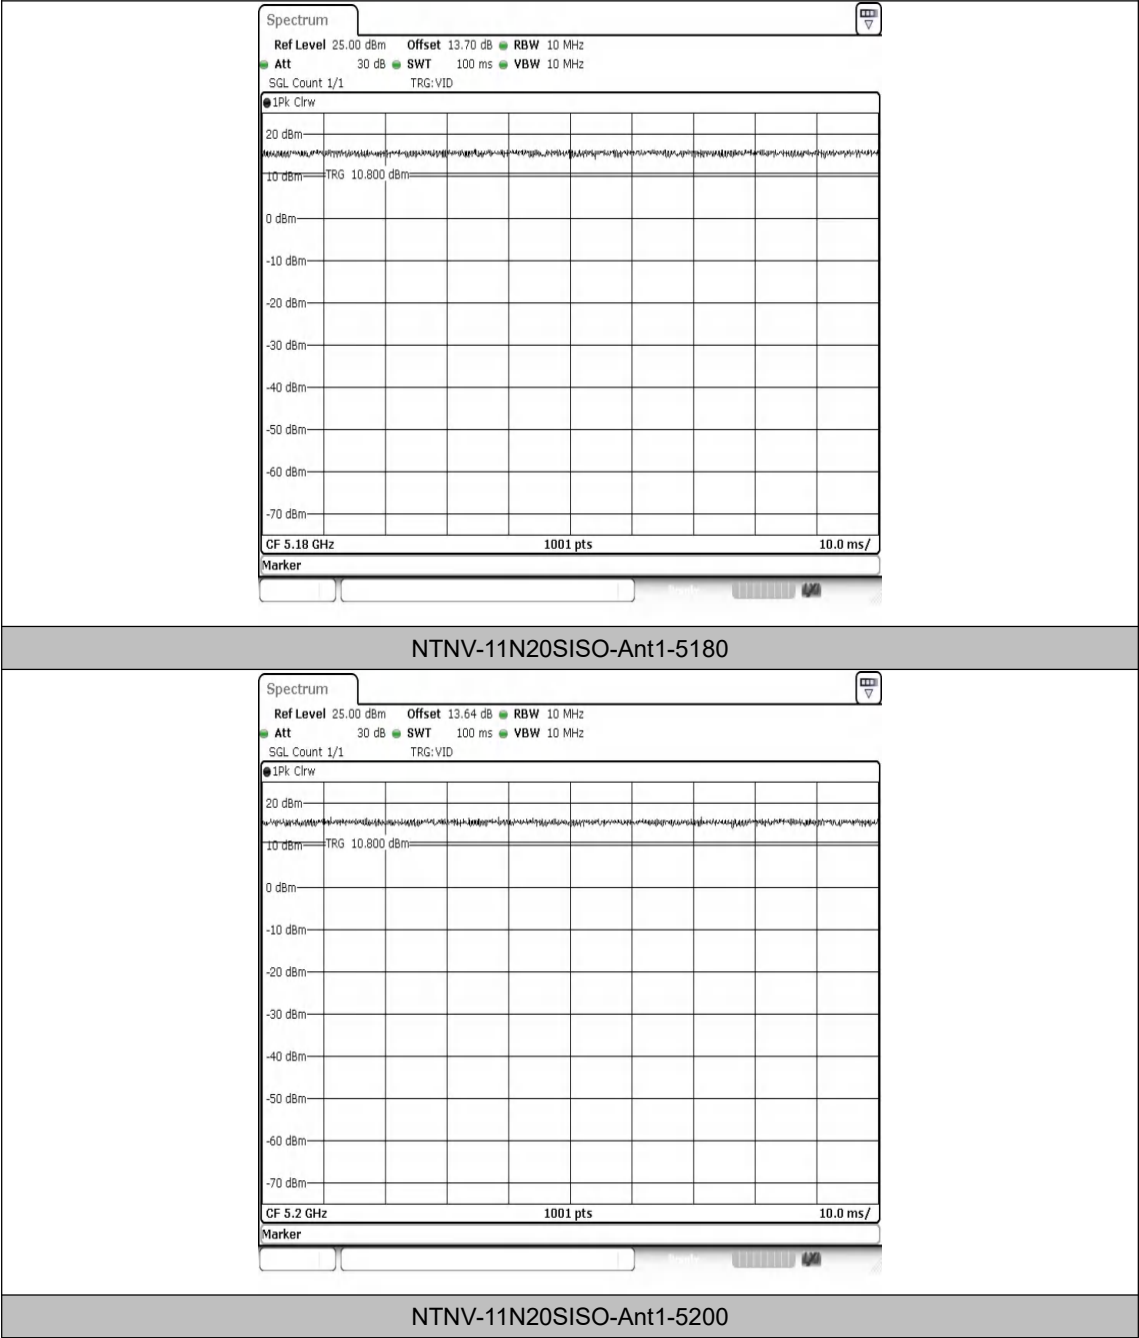

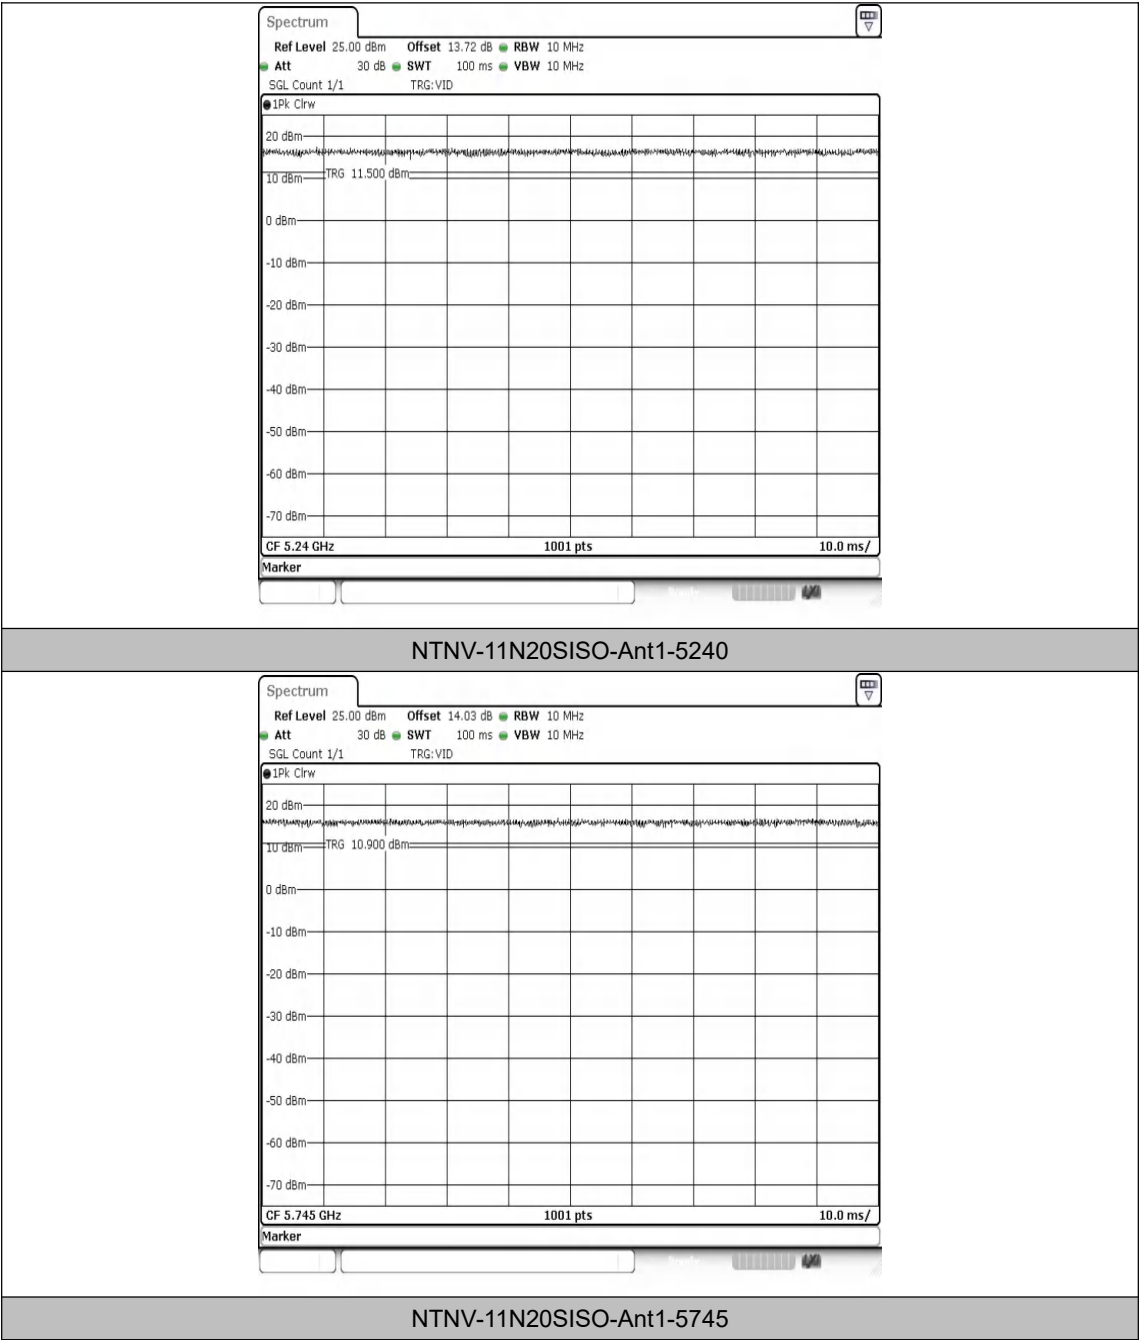

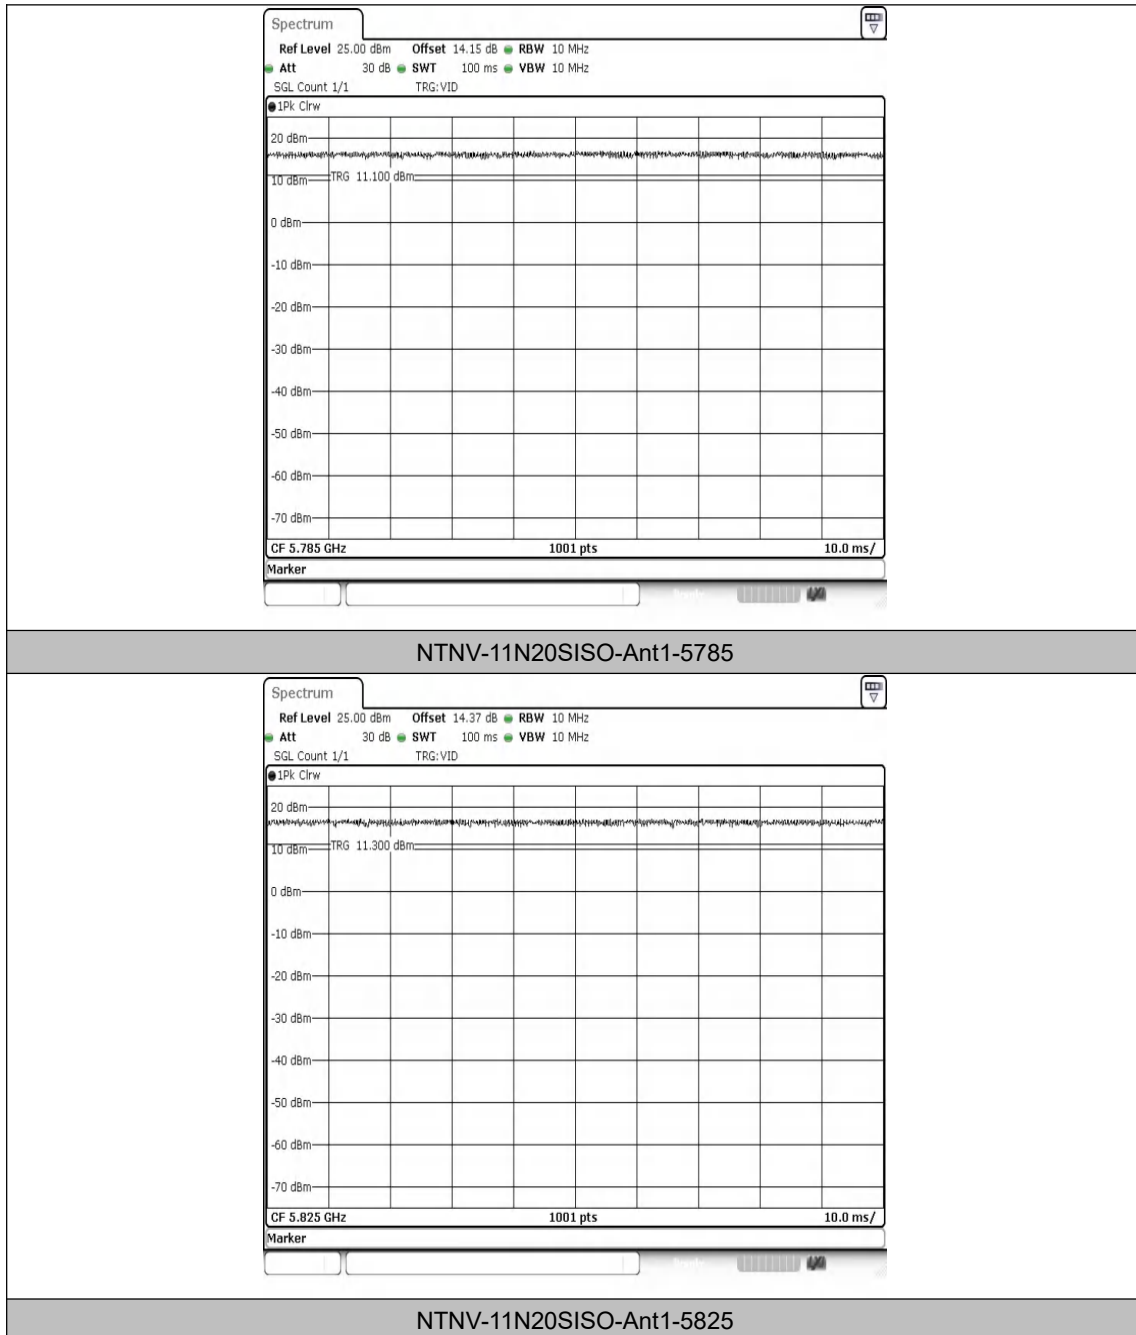


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



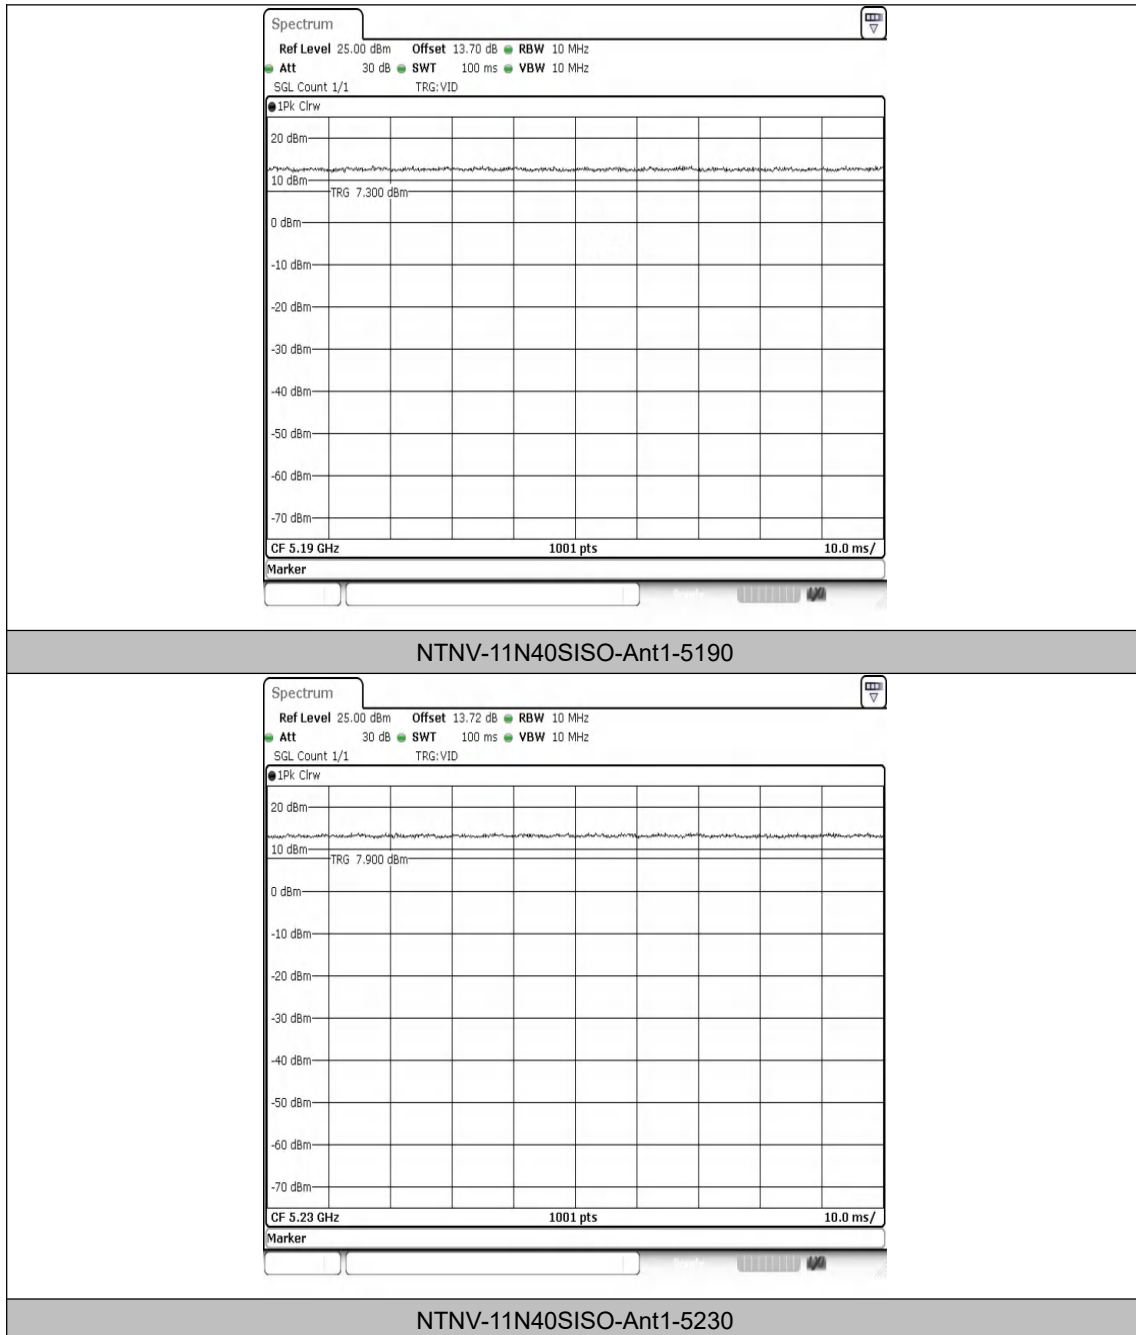


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



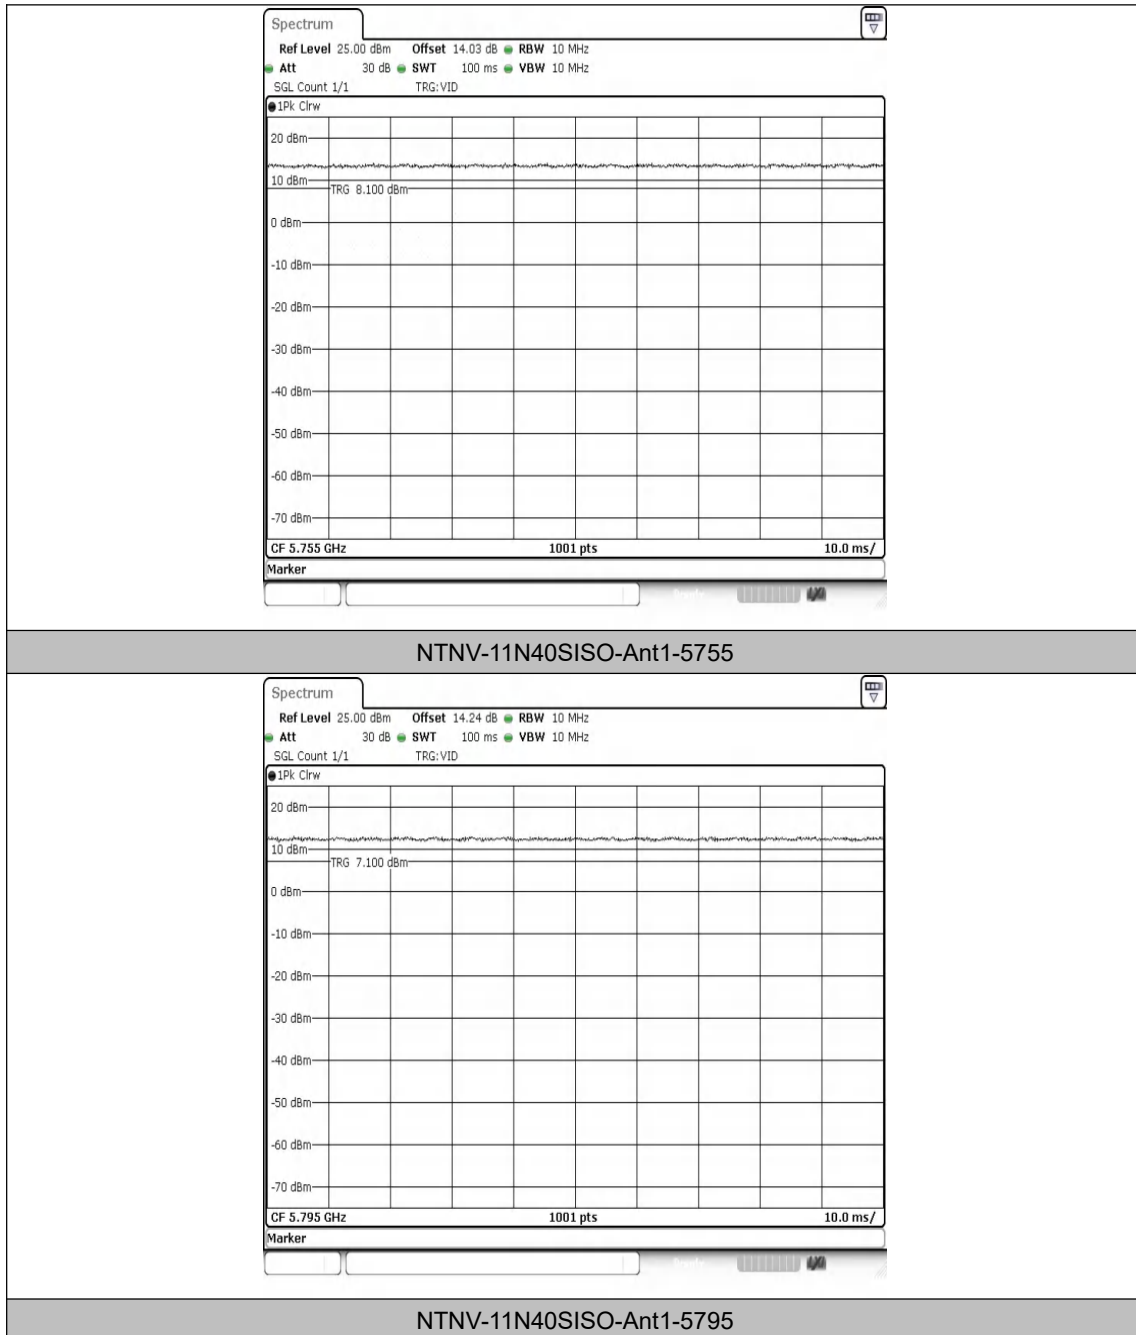


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



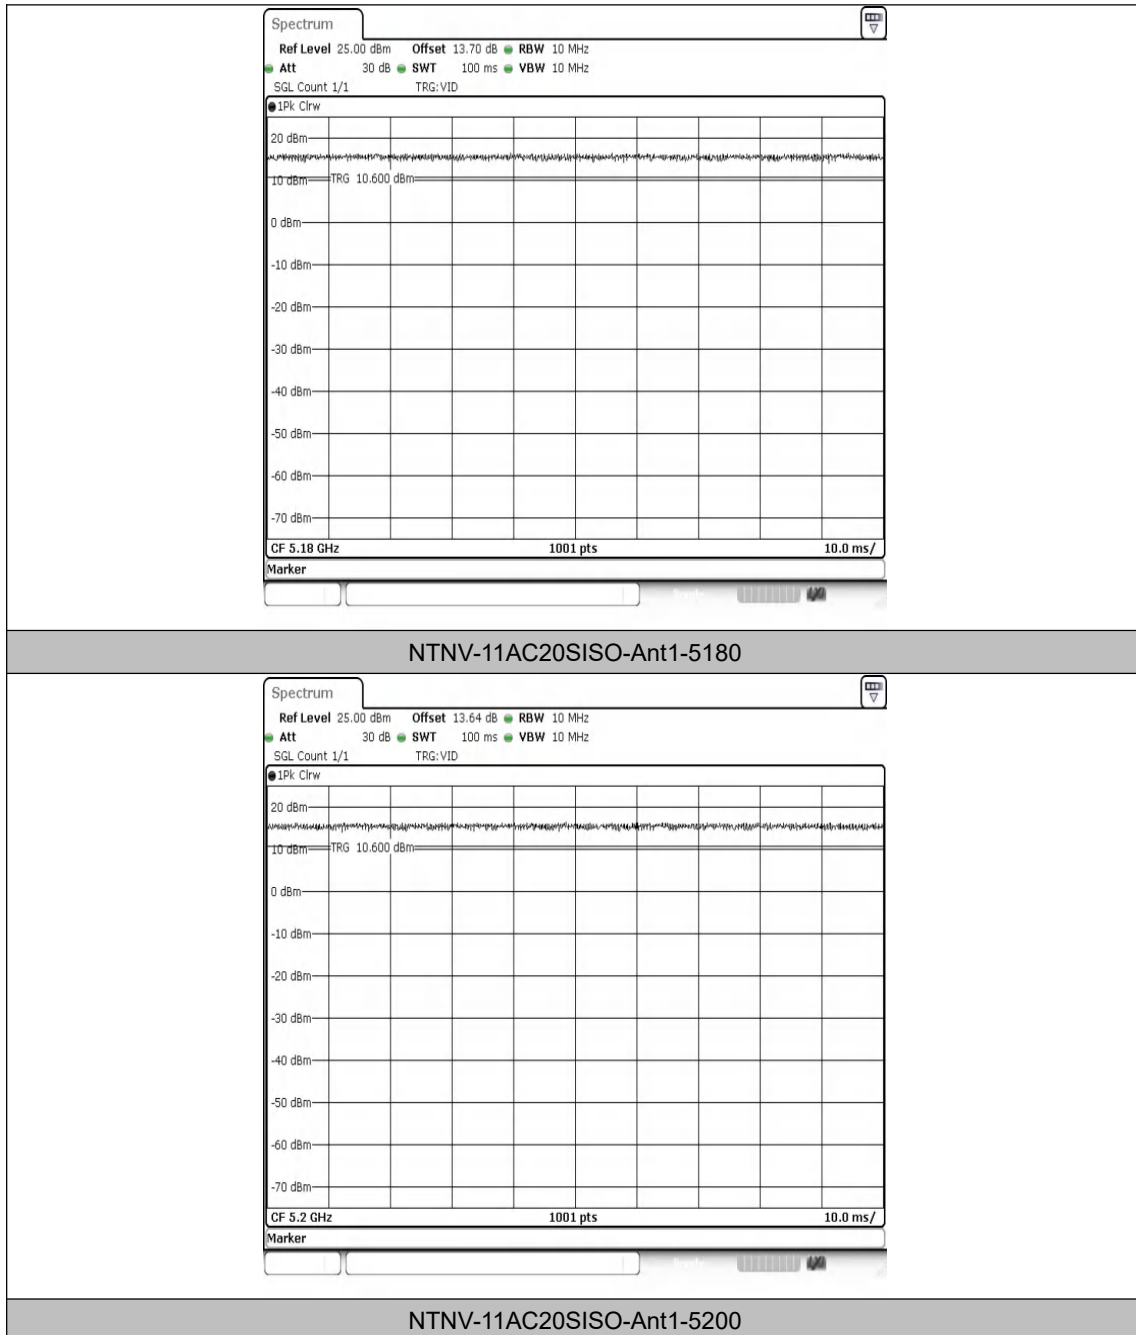


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



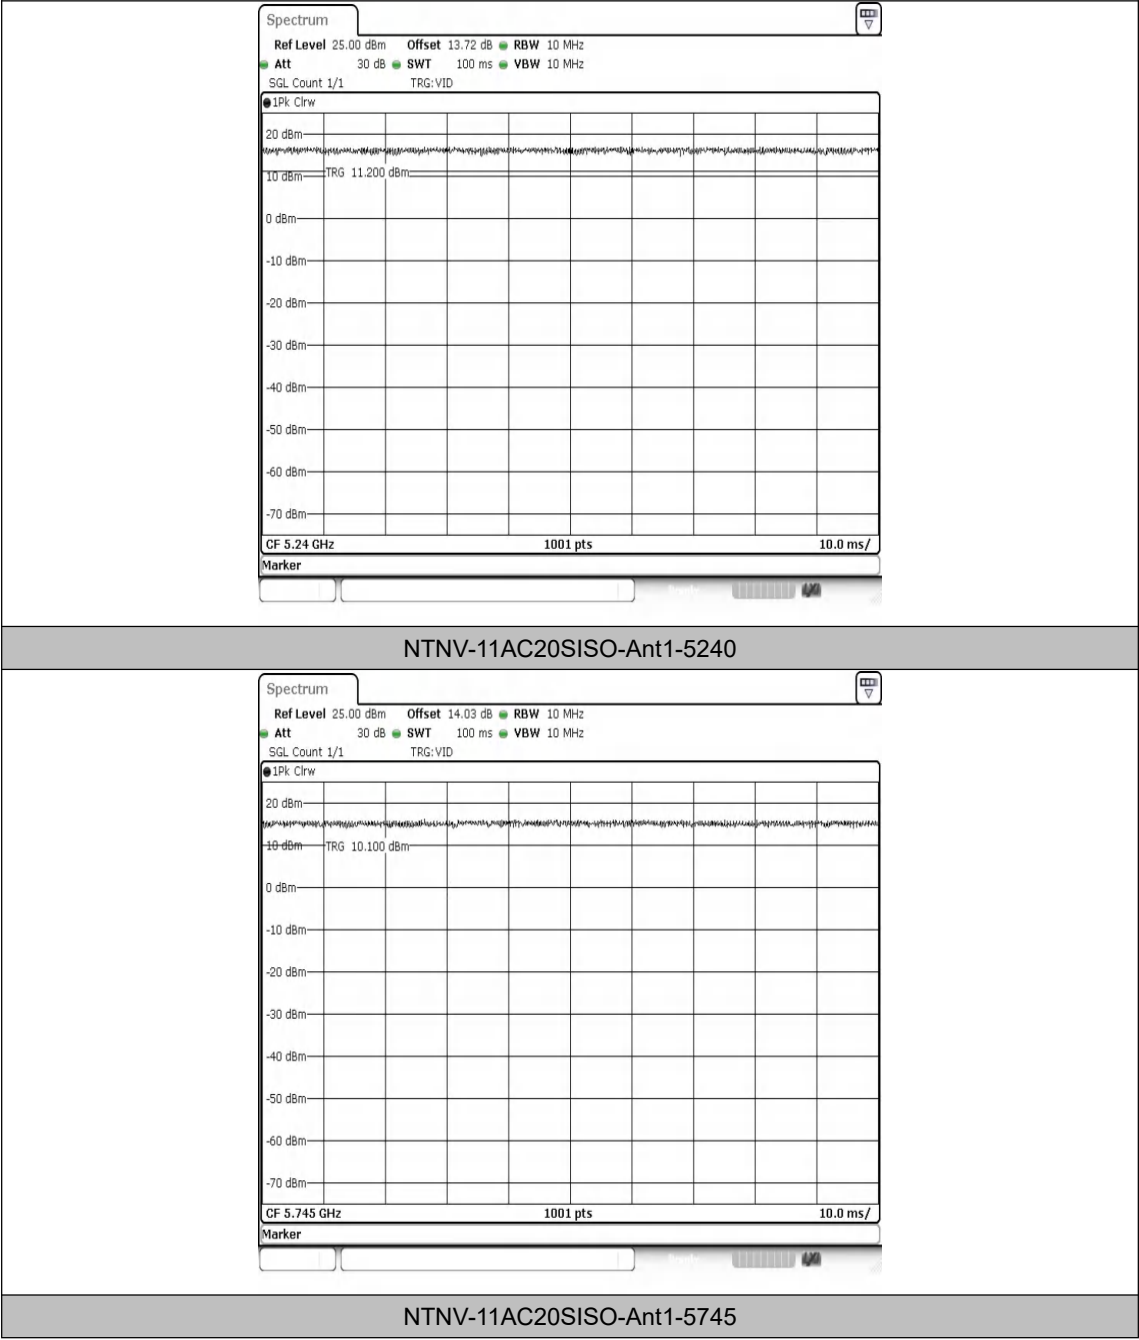

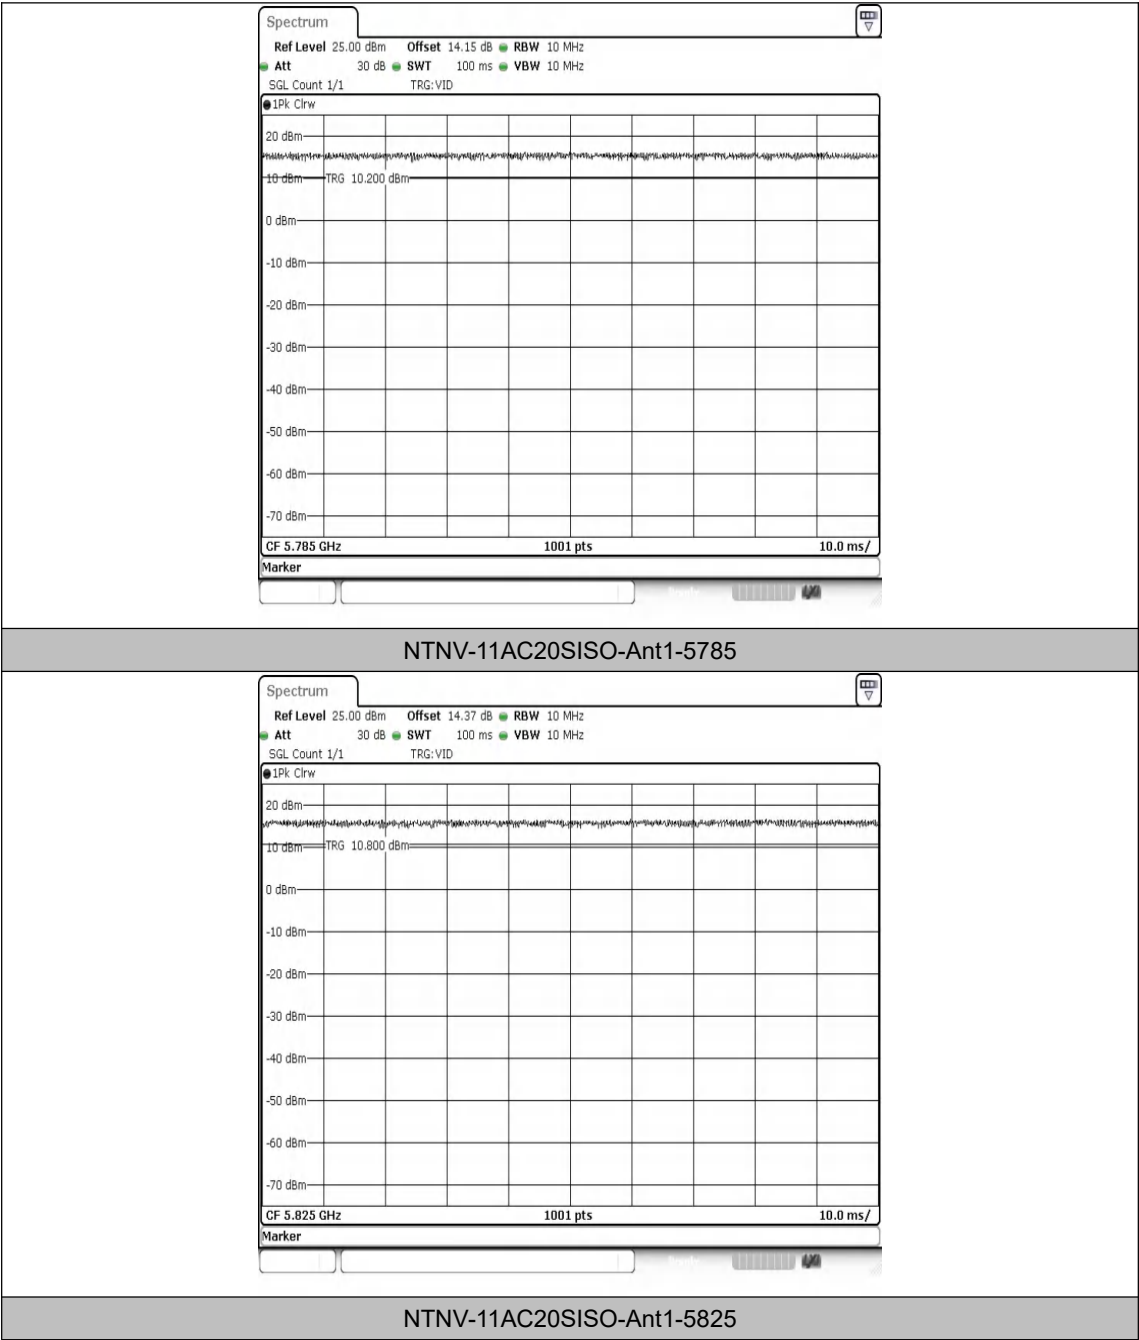


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



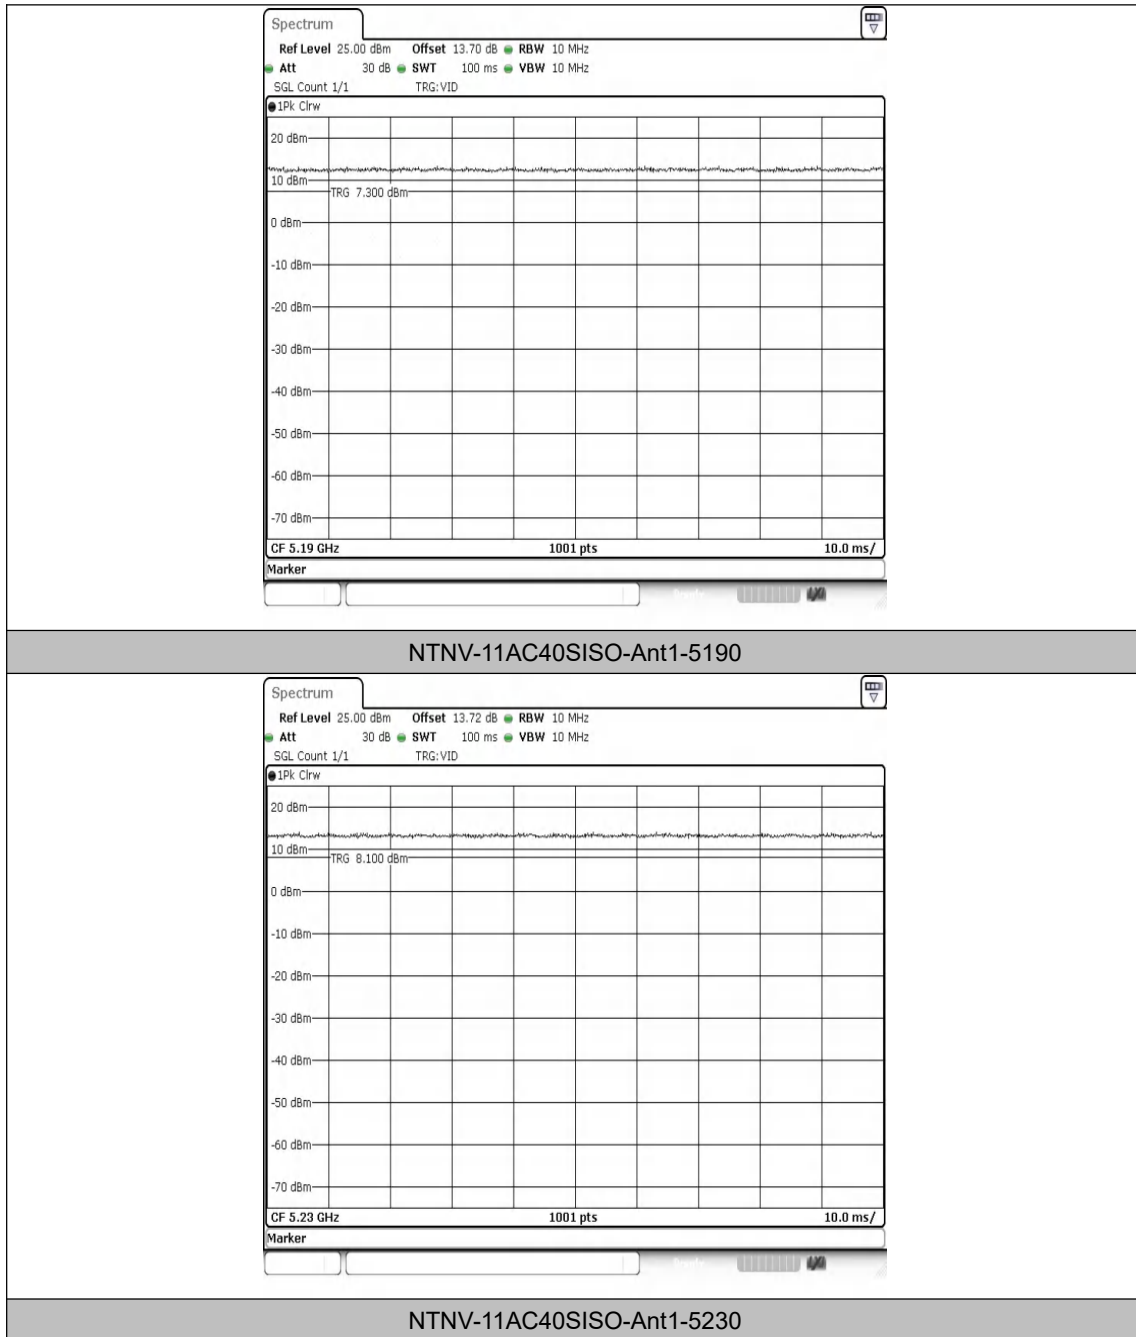


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



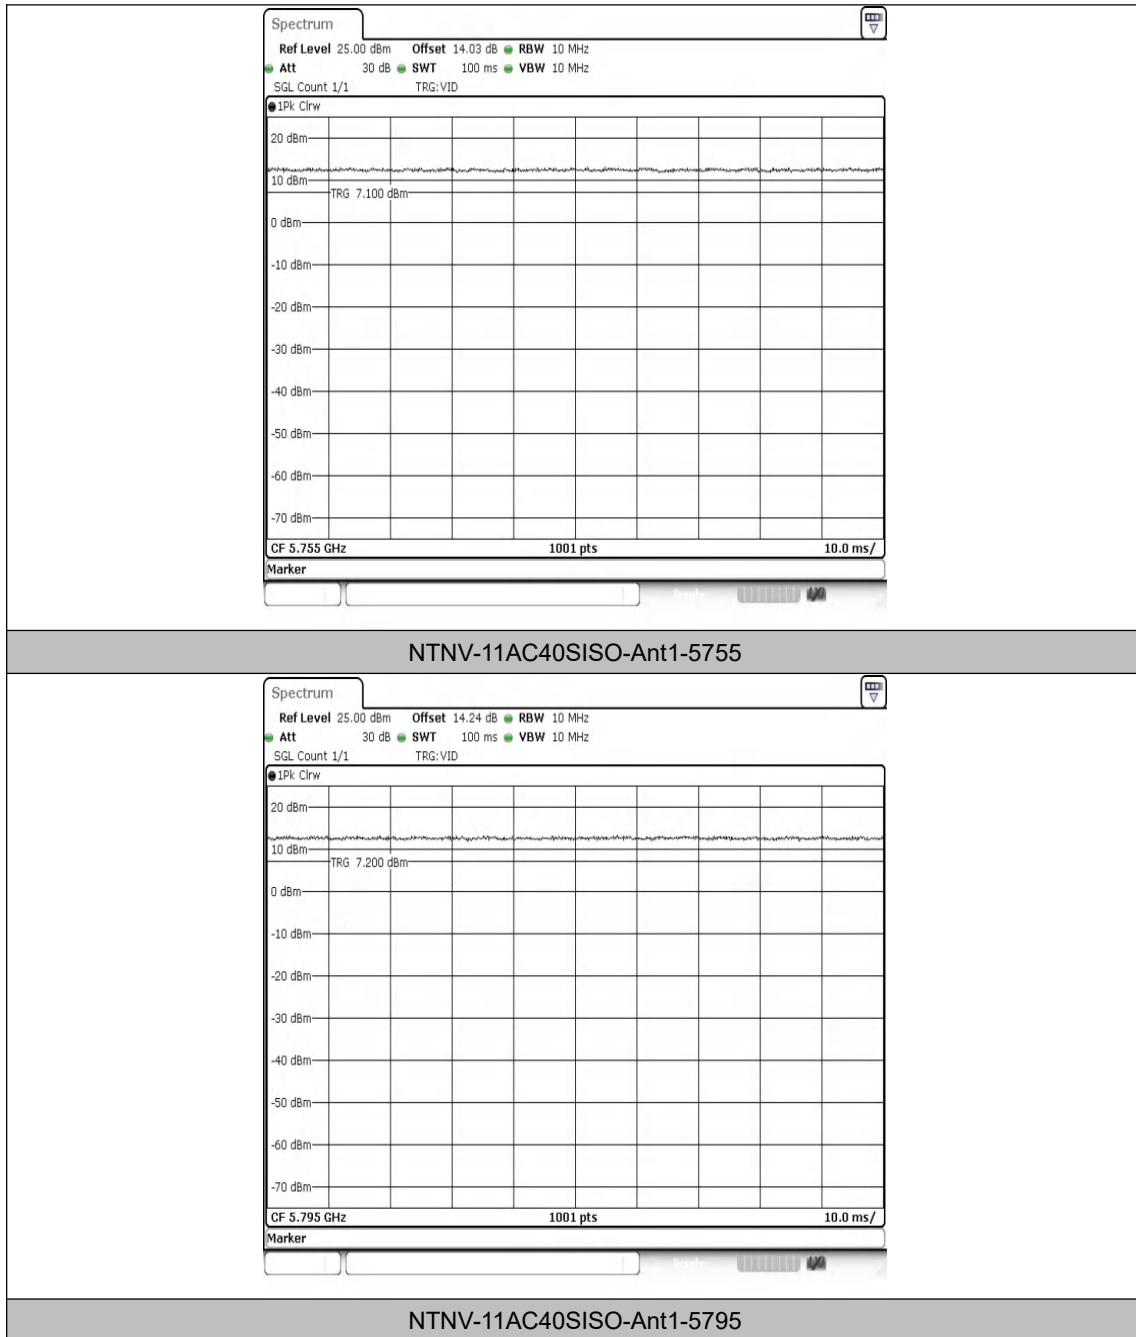


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



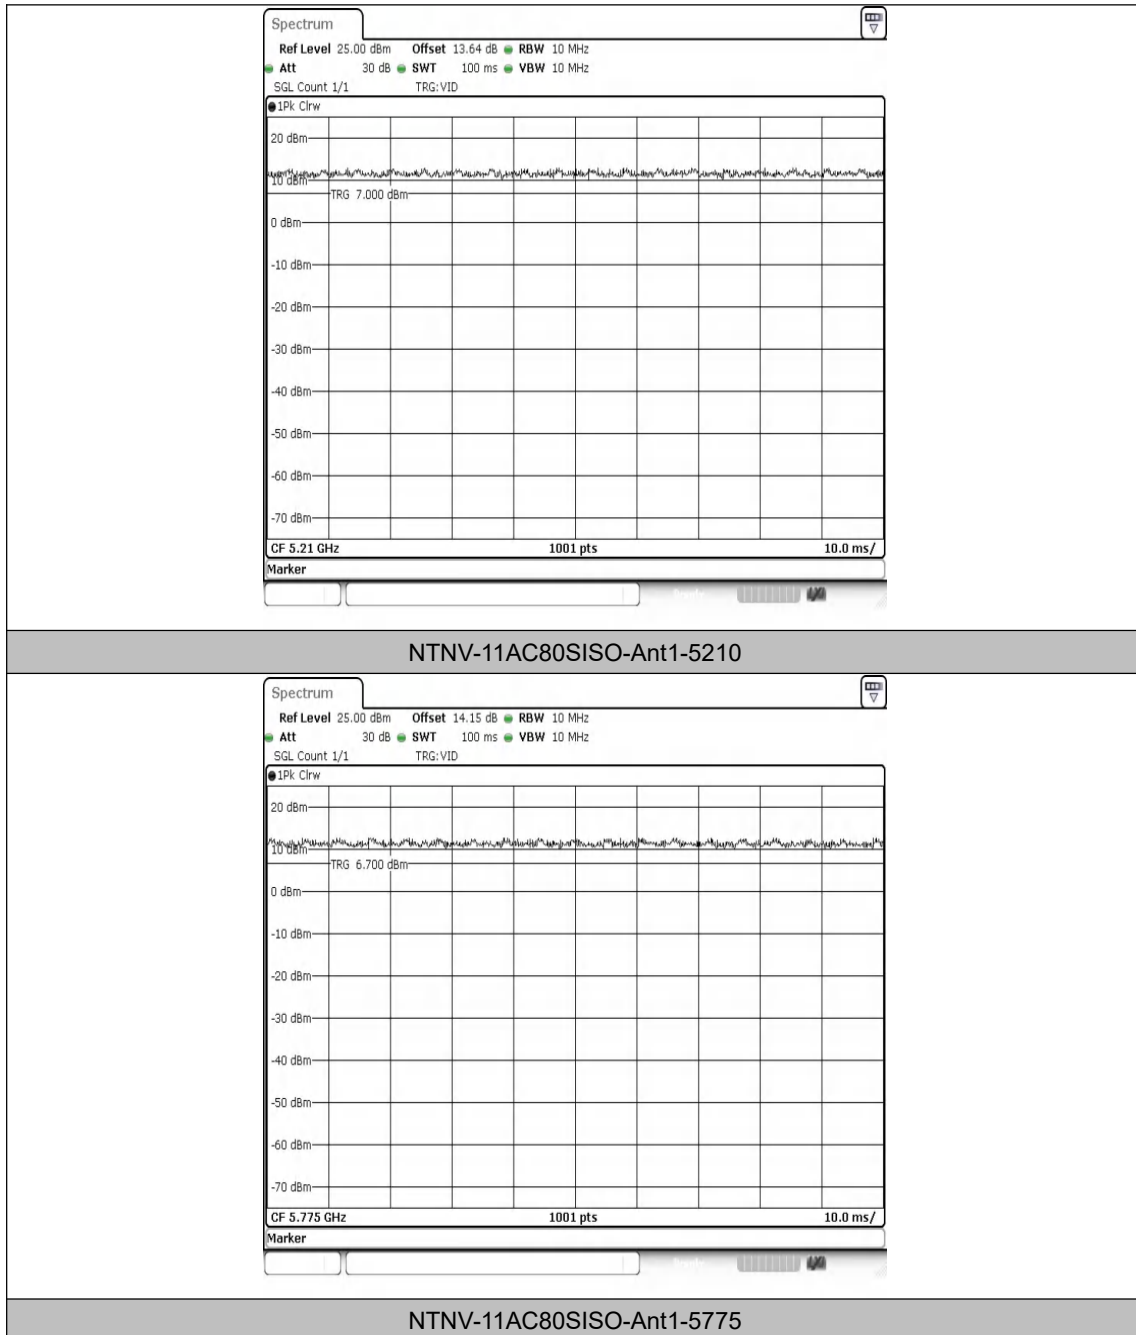

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



Appendix C: Maximum conducted output power


Test Result Channel Power

Test Mode	Antenna	Frequency [MHz]	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	10.59	99.53	0.02	10.61	≤23.98	PASS
11A	Ant1	5200	10.66	99.05	0.04	10.70	≤23.98	PASS
11A	Ant1	5240	11.38	99.05	0.04	11.42	≤23.98	PASS
11A	Ant1	5745	11.07	99.05	0.04	11.11	≤30.00	PASS
11A	Ant1	5785	11.28	99.53	0.02	11.30	≤30.00	PASS
11A	Ant1	5825	11.56	99.05	0.04	11.60	≤30.00	PASS
11N20SISO	Ant1	5180	10.32	100.00	0.00	10.32	≤23.98	PASS
11N20SISO	Ant1	5200	10.35	100.00	0.00	10.35	≤23.98	PASS
11N20SISO	Ant1	5240	11.08	100.00	0.00	11.08	≤23.98	PASS
11N20SISO	Ant1	5745	10.76	100.00	0.00	10.76	≤30.00	PASS
11N20SISO	Ant1	5785	11.01	100.00	0.00	11.01	≤30.00	PASS
11N20SISO	Ant1	5825	11.28	100.00	0.00	11.28	≤30.00	PASS
11N40SISO	Ant1	5190	10.57	100.00	0.00	10.57	≤23.98	PASS
11N40SISO	Ant1	5230	11.14	100.00	0.00	11.14	≤23.98	PASS
11N40SISO	Ant1	5755	11.43	100.00	0.00	11.43	≤30.00	PASS
11N40SISO	Ant1	5795	10.55	100.00	0.00	10.55	≤30.00	PASS
11AC20SISO	Ant1	5180	10.29	100.00	0.00	10.29	≤23.98	PASS
11AC20SISO	Ant1	5200	10.35	100.00	0.00	10.35	≤23.98	PASS
11AC20SISO	Ant1	5240	11.04	100.00	0.00	11.04	≤23.98	PASS
11AC20SISO	Ant1	5745	10.05	100.00	0.00	10.05	≤30.00	PASS
11AC20SISO	Ant1	5785	10.24	100.00	0.00	10.24	≤30.00	PASS
11AC20SISO	Ant1	5825	10.59	100.00	0.00	10.59	≤30.00	PASS
11AC40SISO	Ant1	5190	10.44	100.00	0.00	10.44	≤23.98	PASS
11AC40SISO	Ant1	5230	11.20	100.00	0.00	11.20	≤23.98	PASS
11AC40SISO	Ant1	5755	10.44	100.00	0.00	10.44	≤30.00	PASS
11AC40SISO	Ant1	5795	10.70	100.00	0.00	10.70	≤30.00	PASS
11AC80SISO	Ant1	5210	10.72	100.00	0.00	10.72	≤23.98	PASS
11AC80SISO	Ant1	5775	10.42	100.00	0.00	10.42	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.



Test Graphs Channel Power

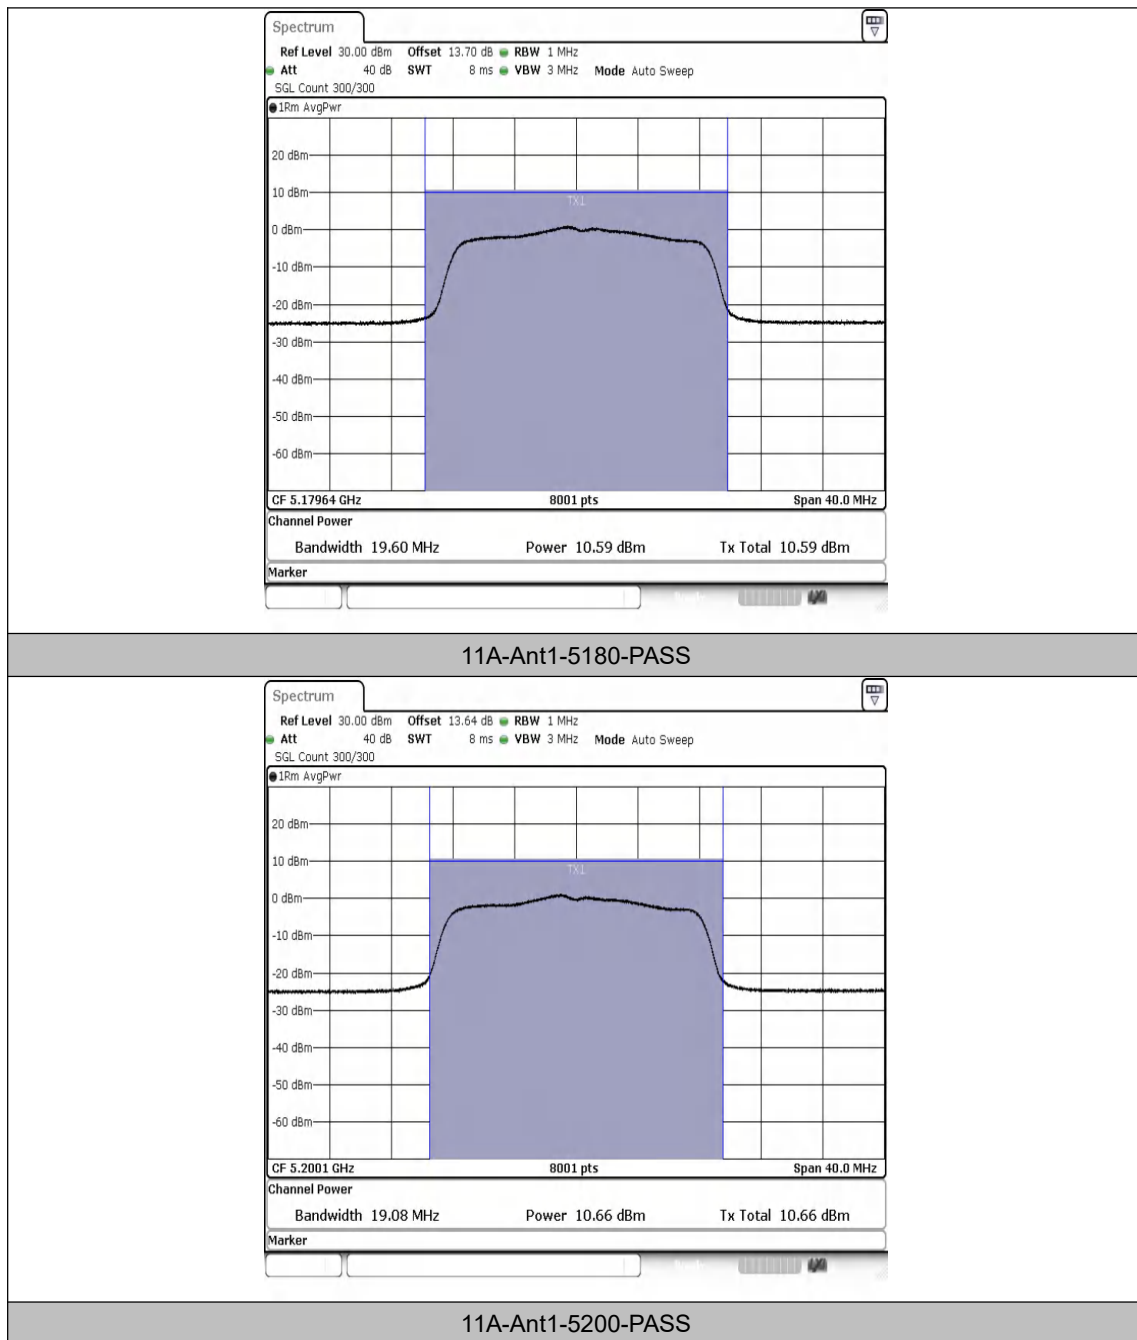


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



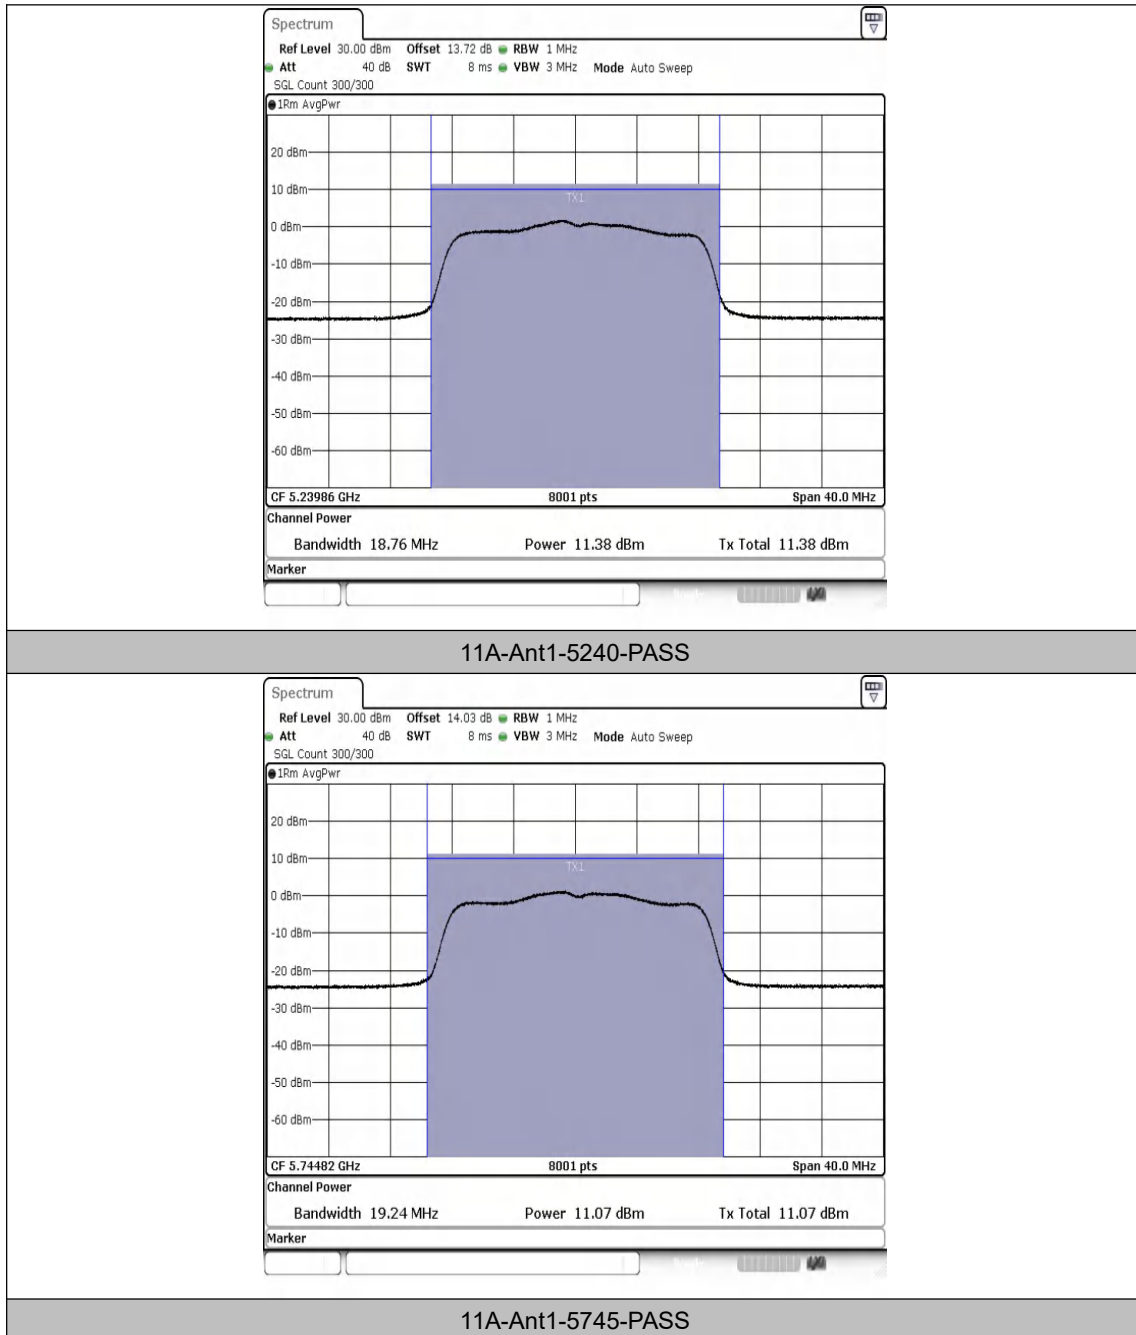


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
 400-003-0500
www.anbotek.com



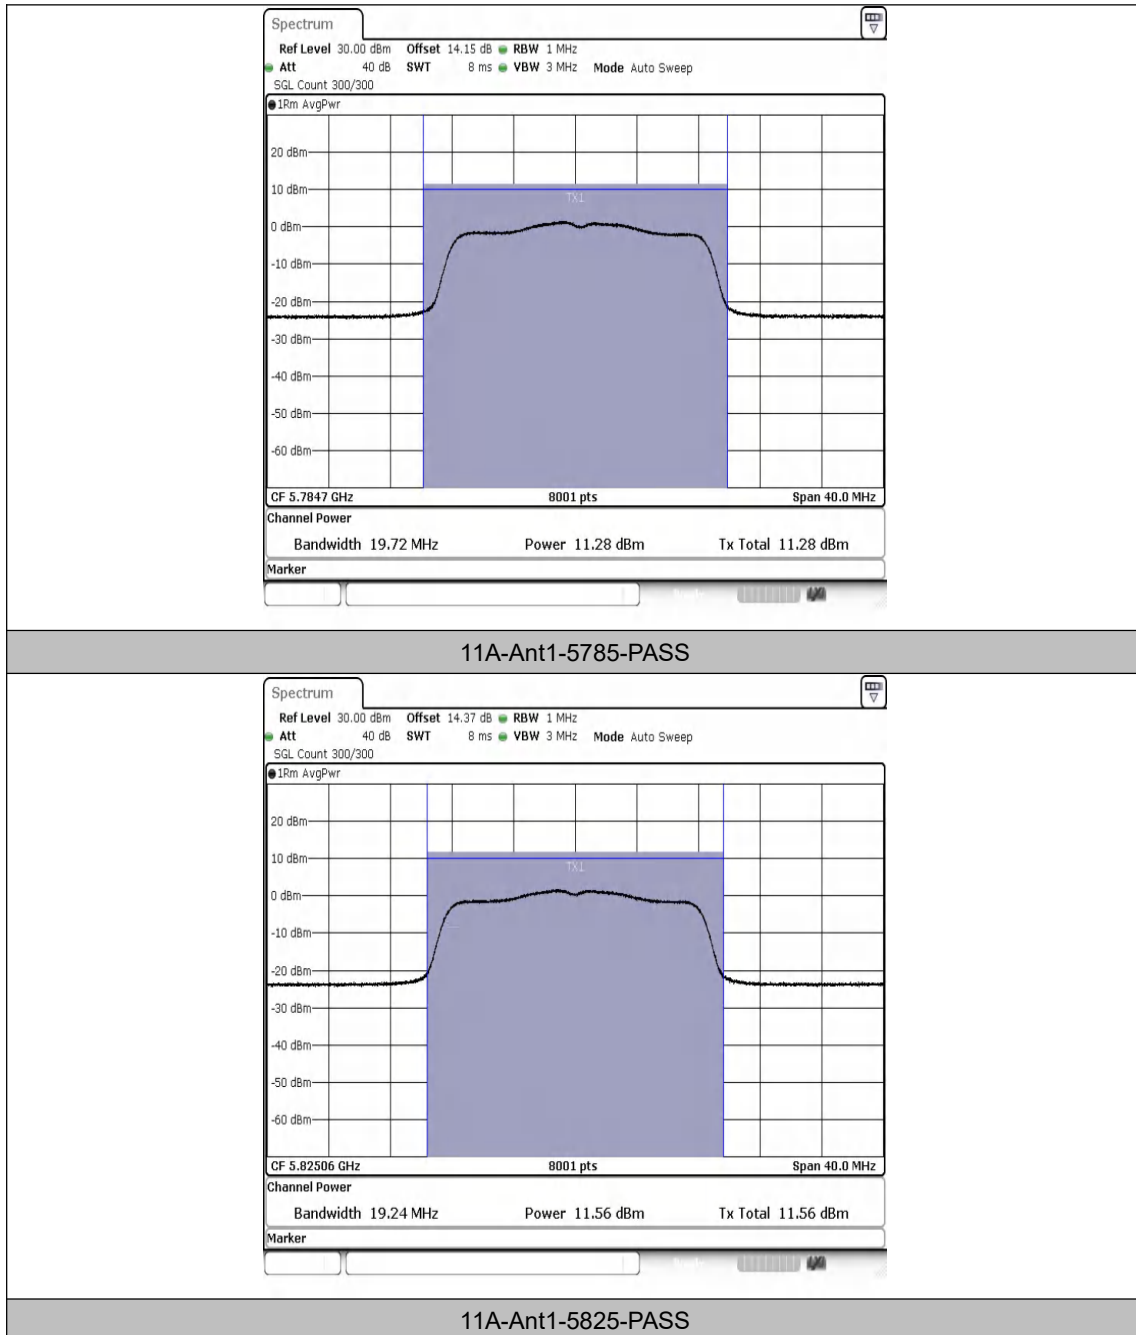


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



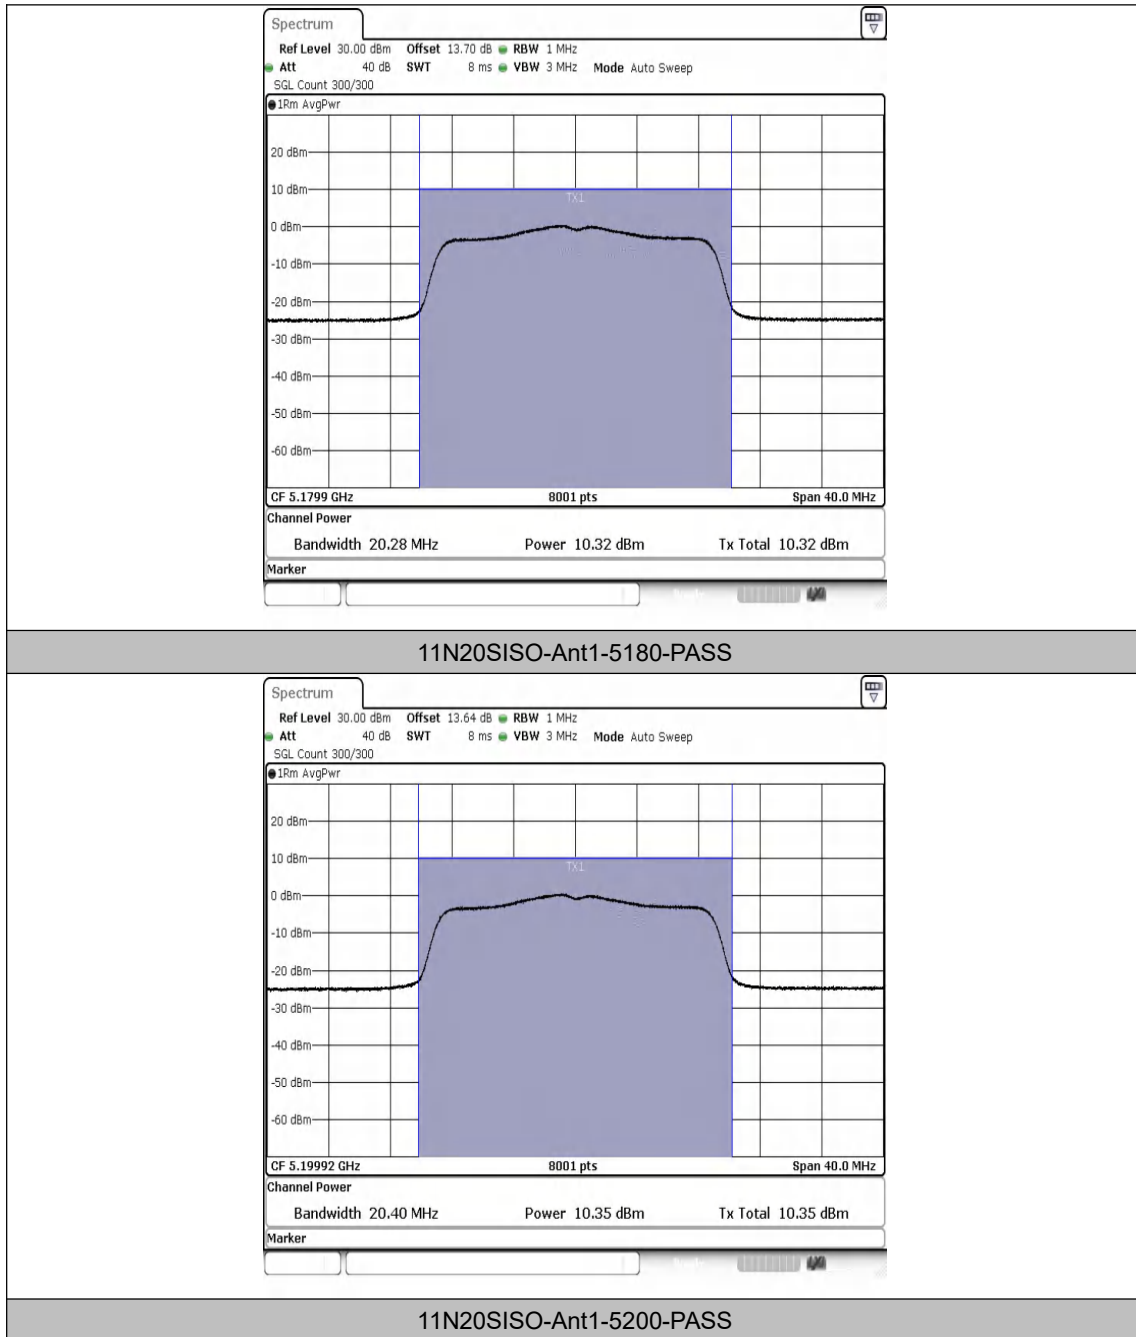


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



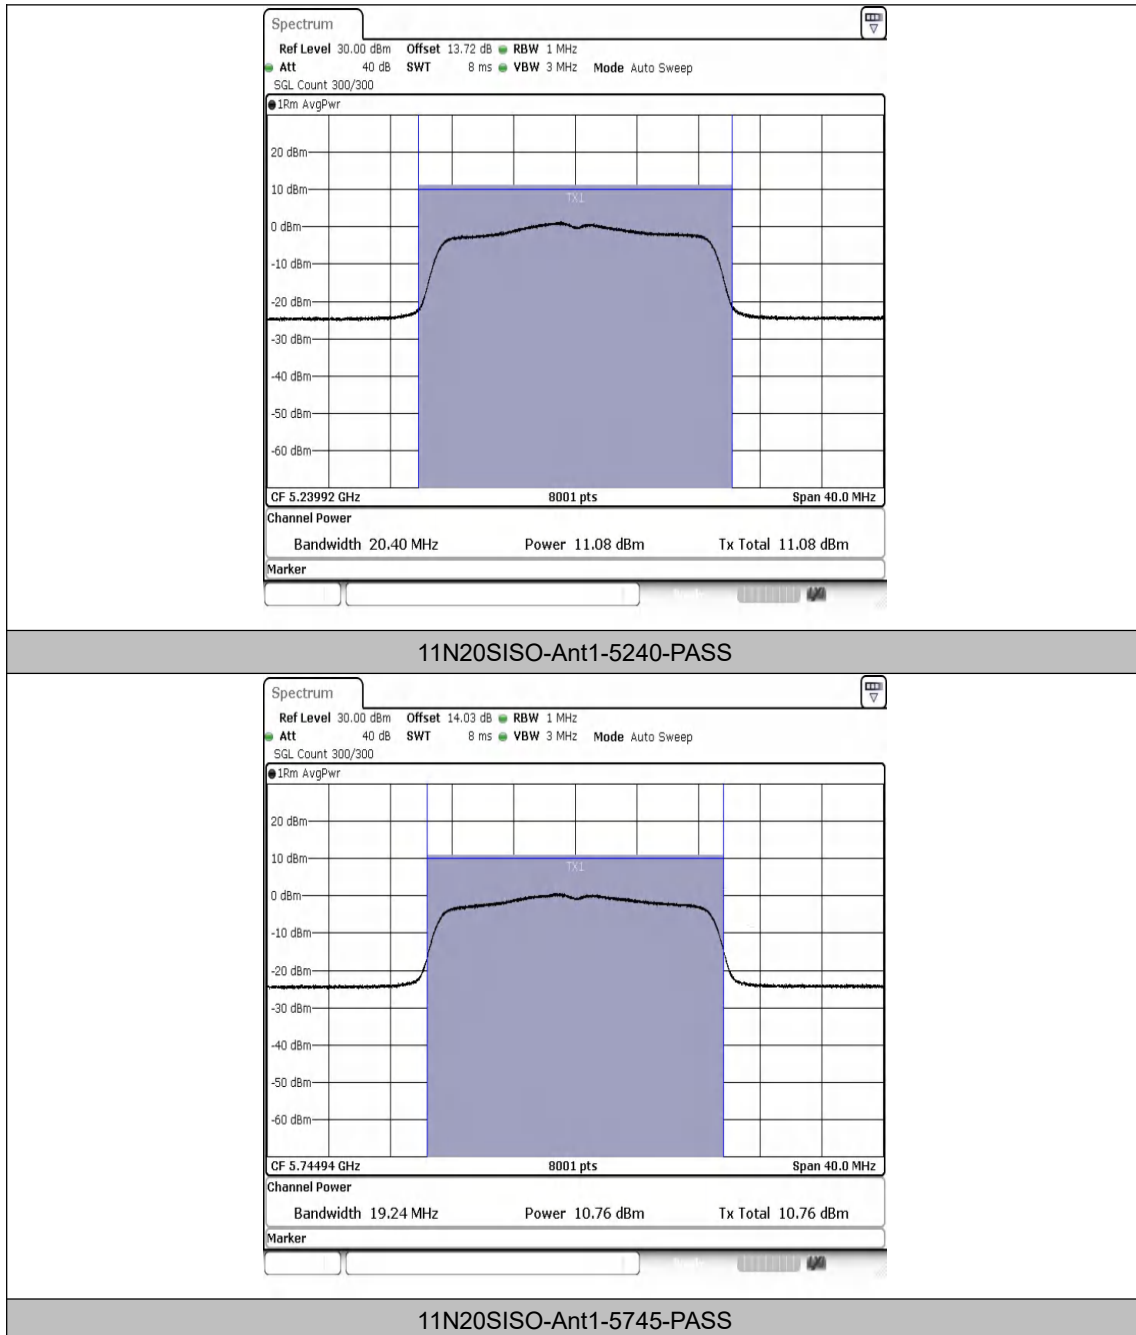


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



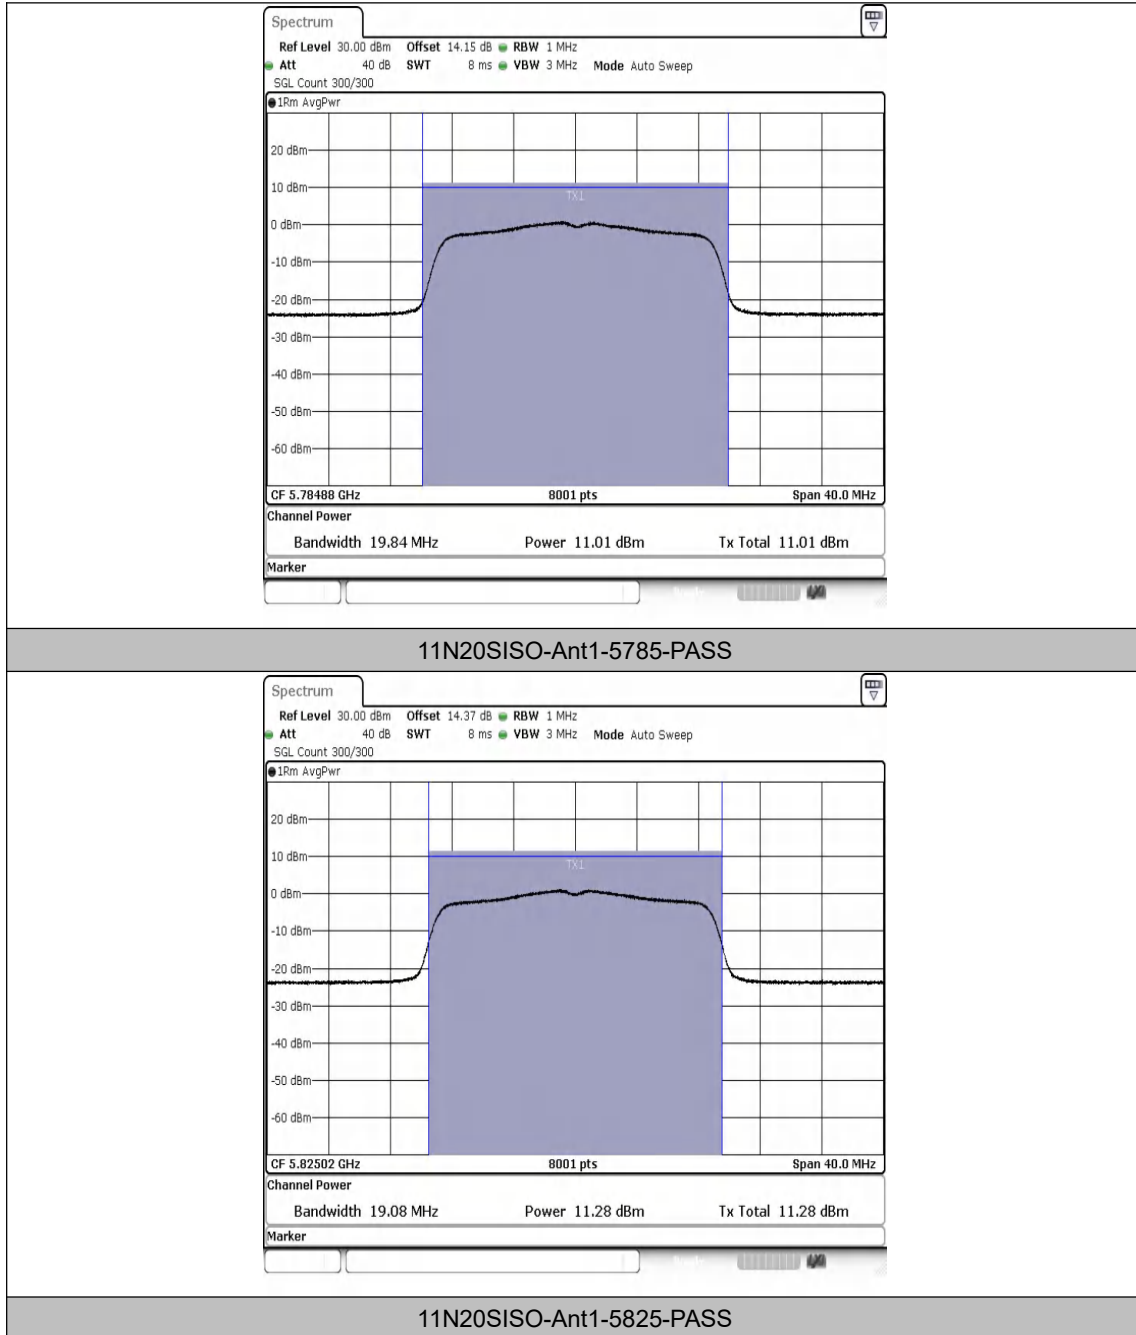


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



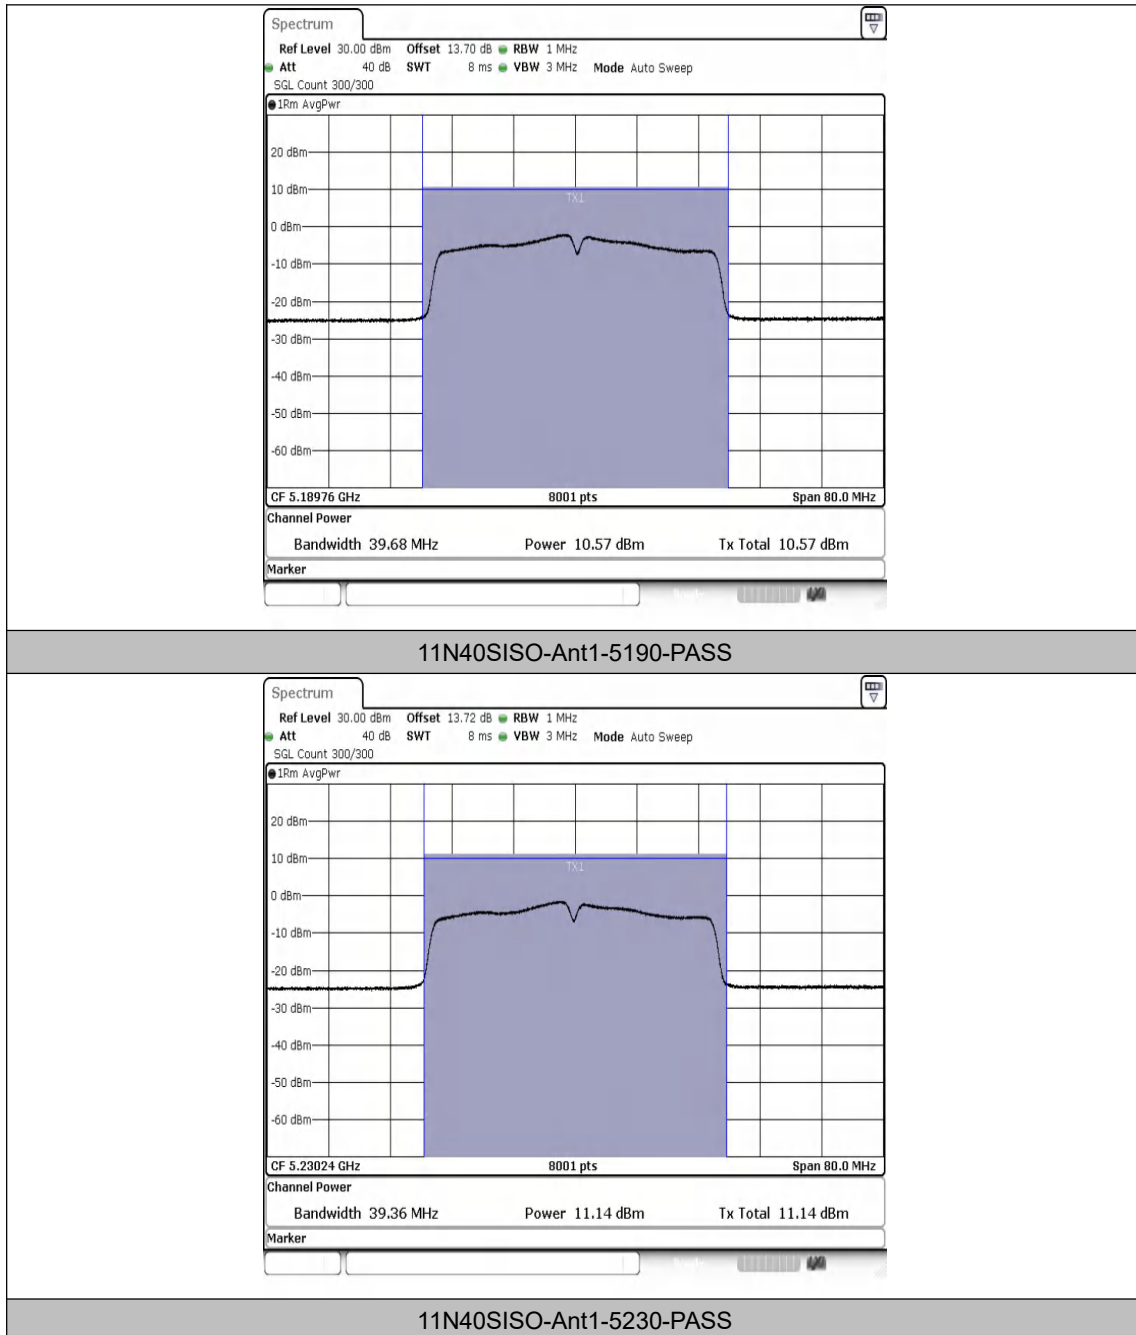


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



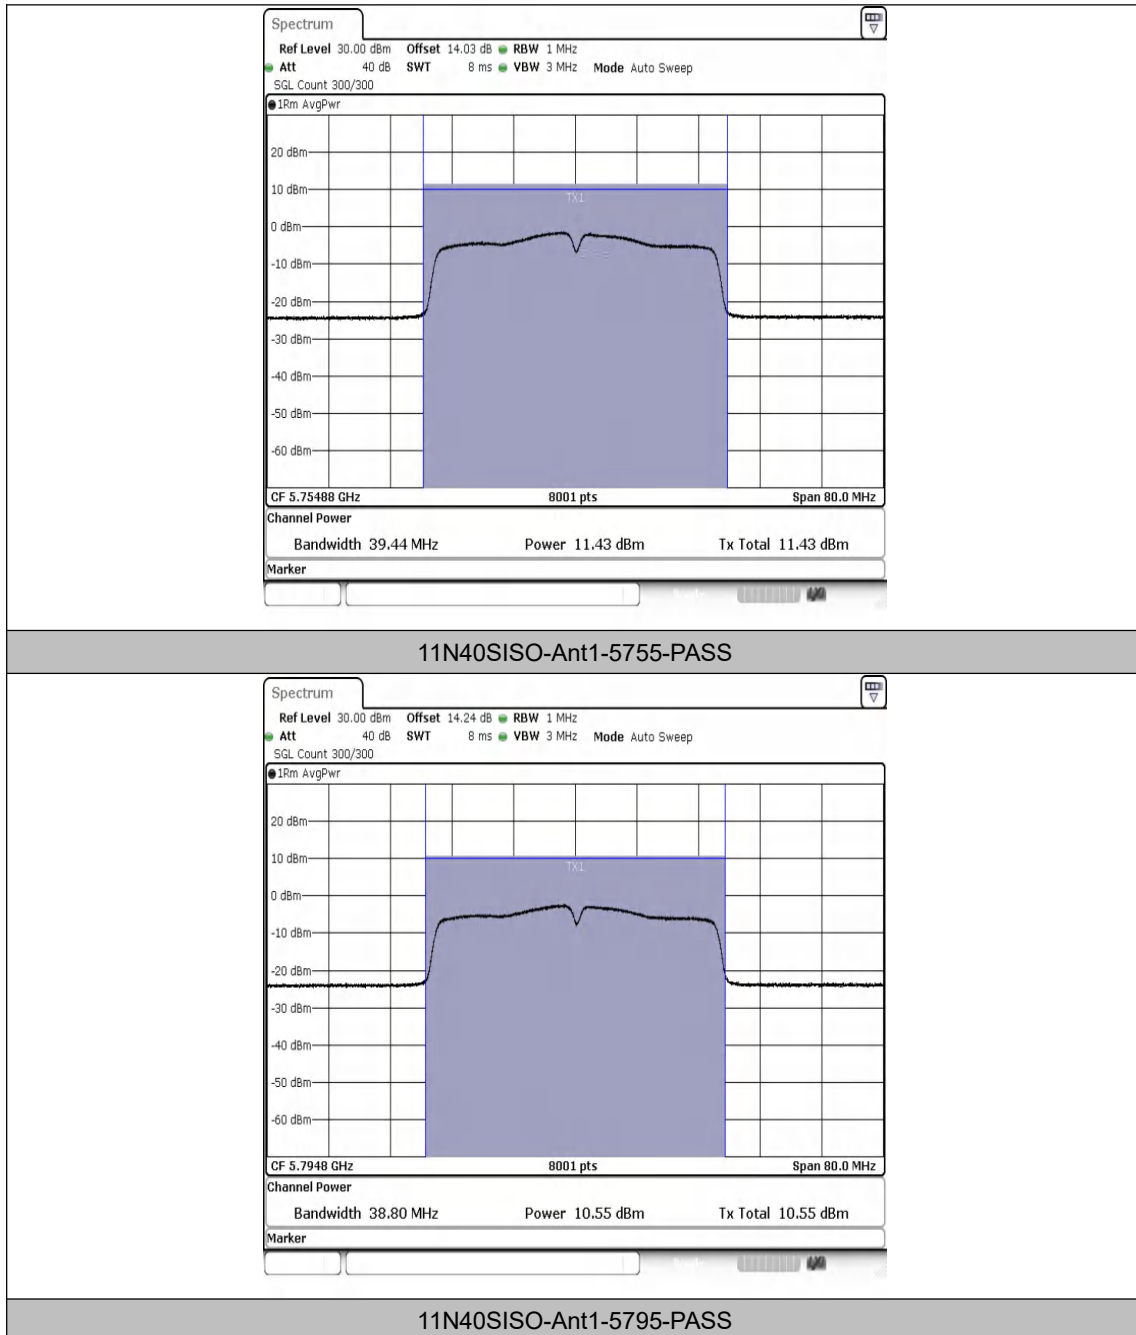


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



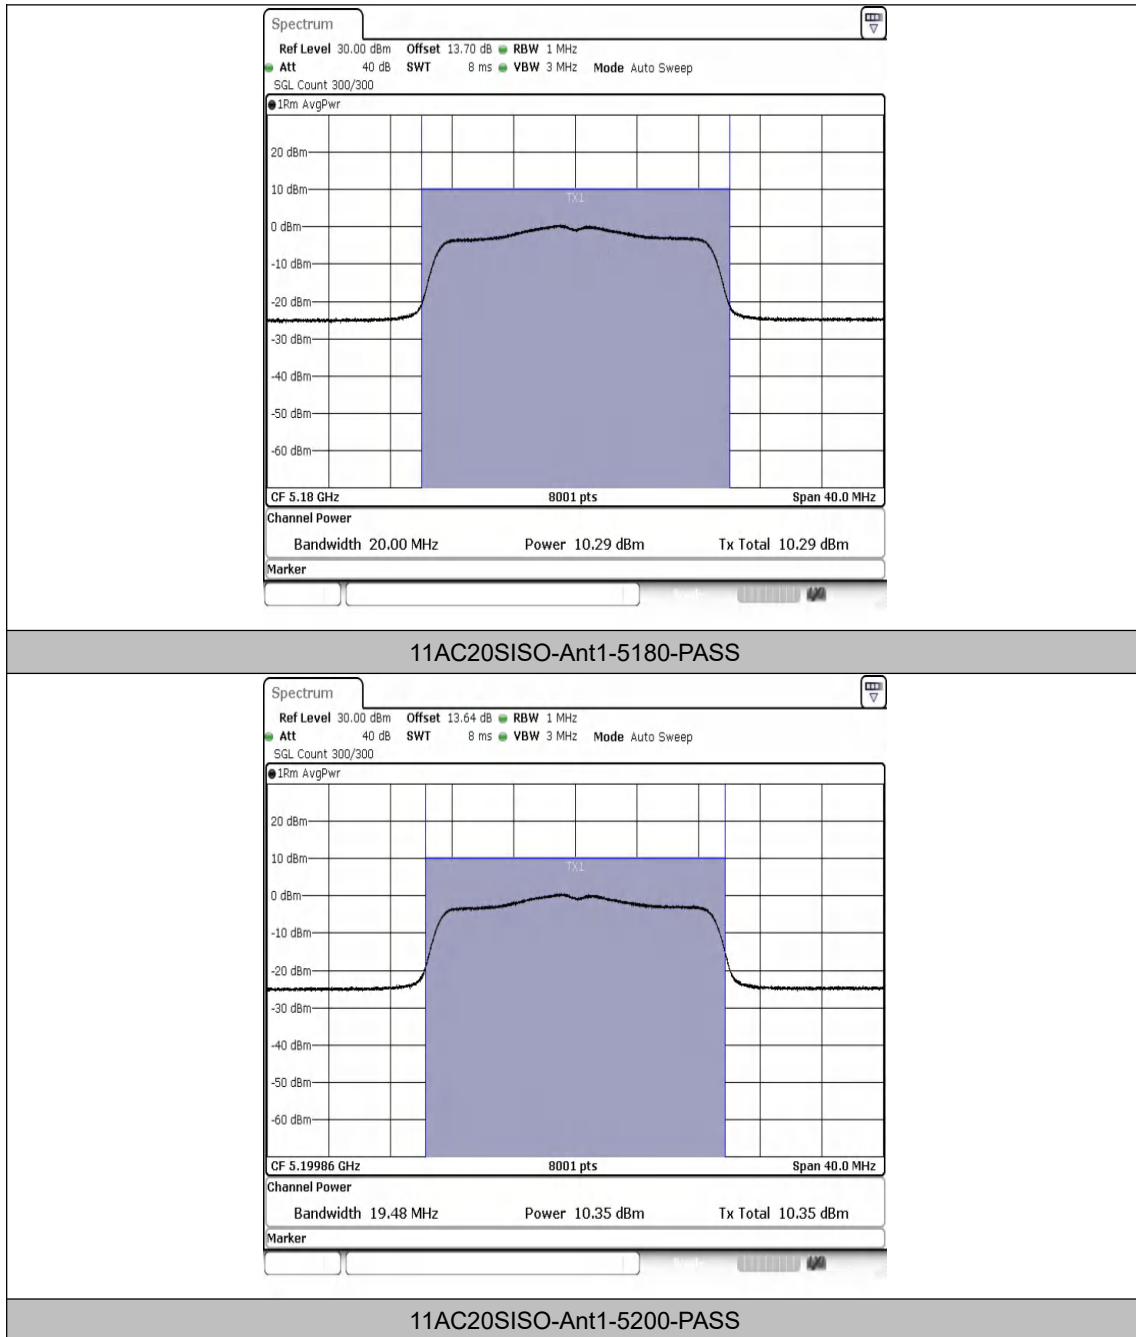


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



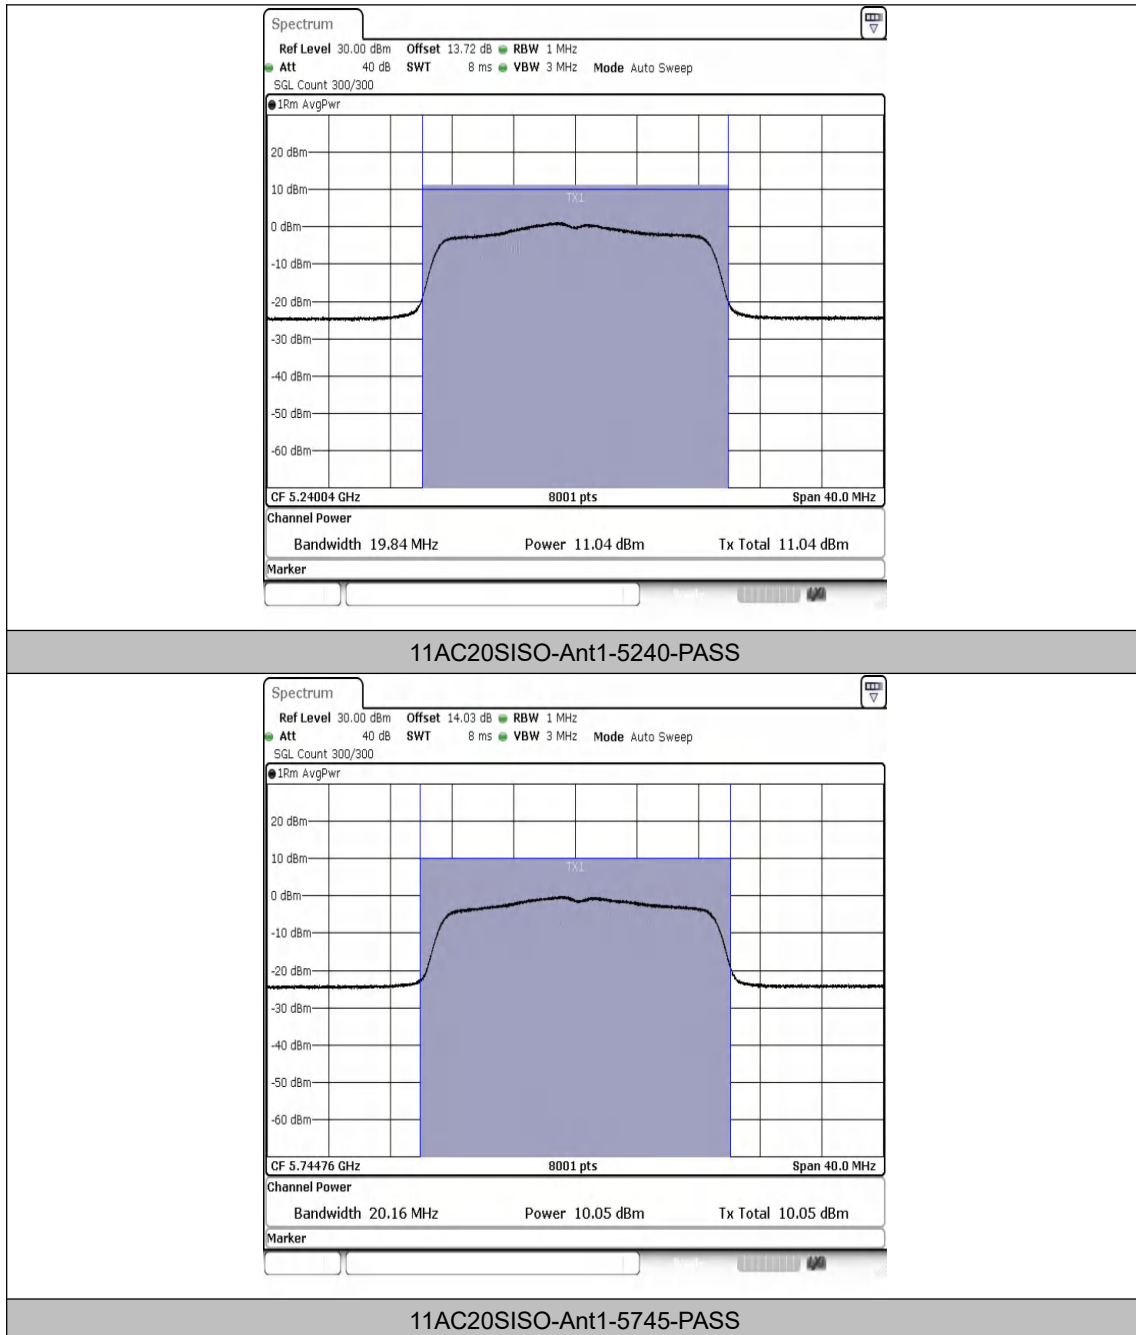


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
 400-003-0500
 www.anbotek.com



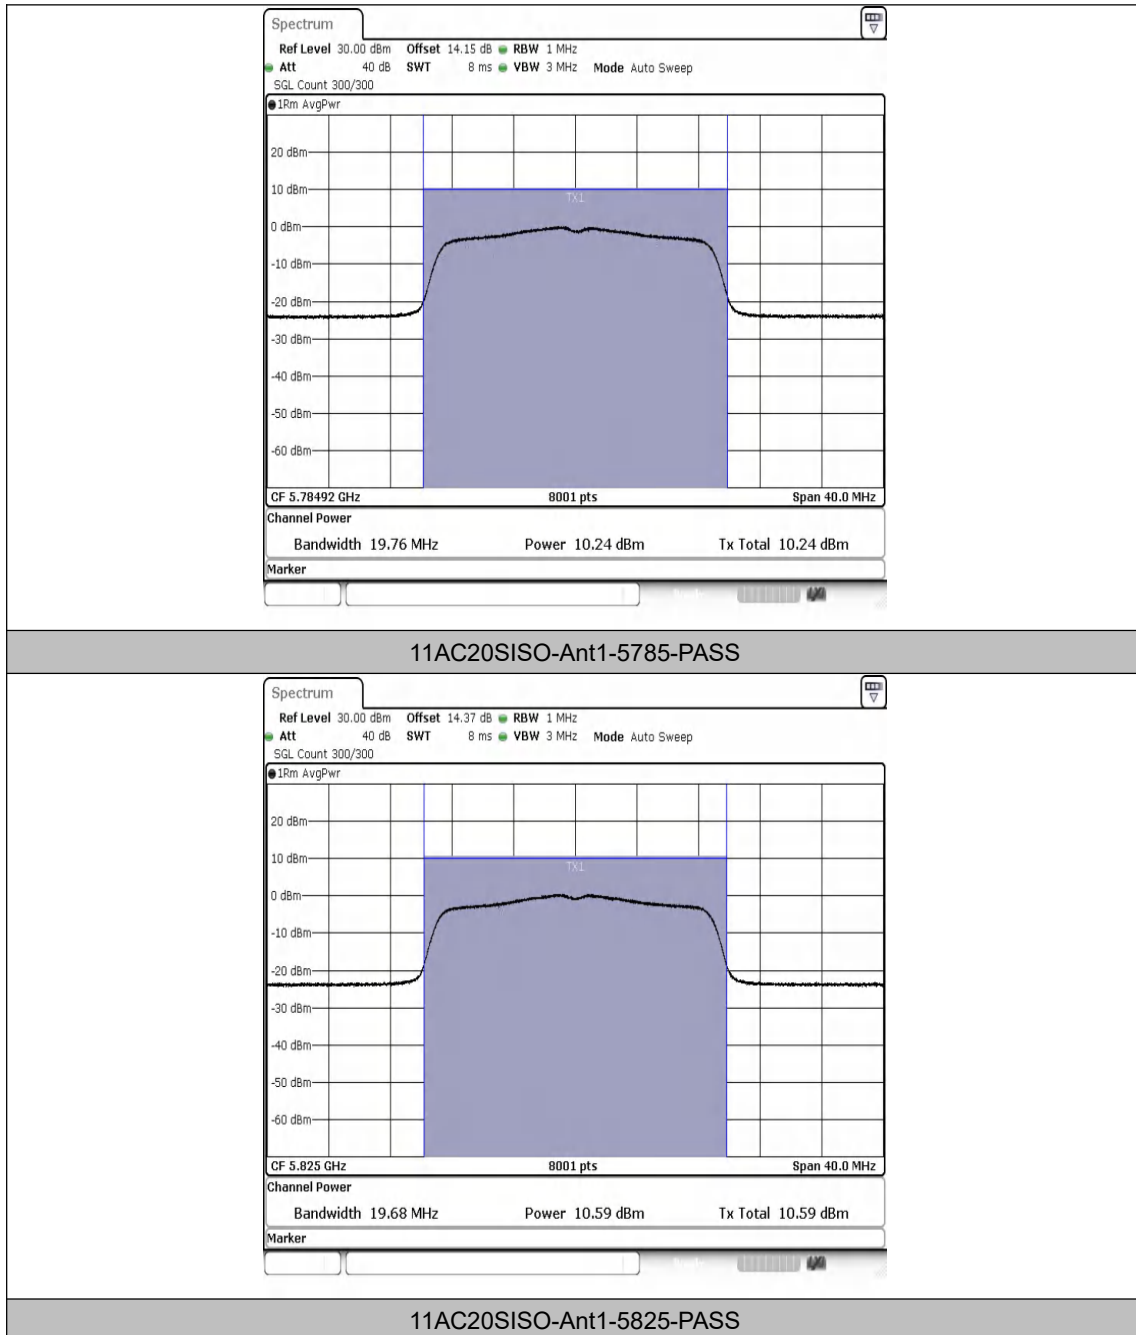


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
 400-003-0500
 www.anbotek.com



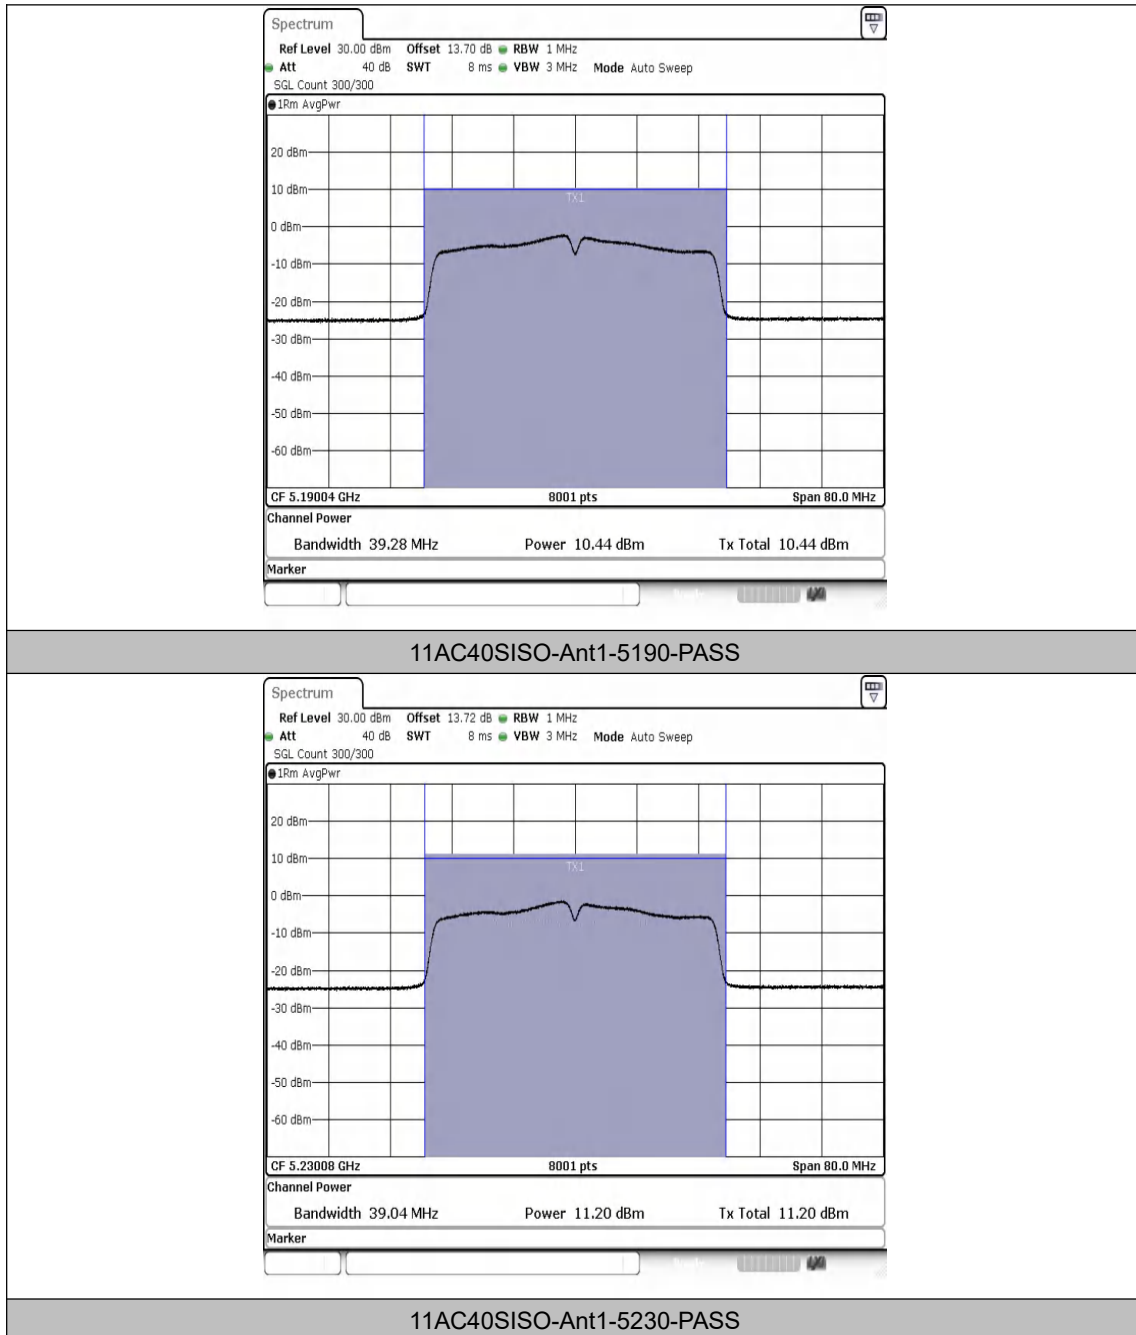


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



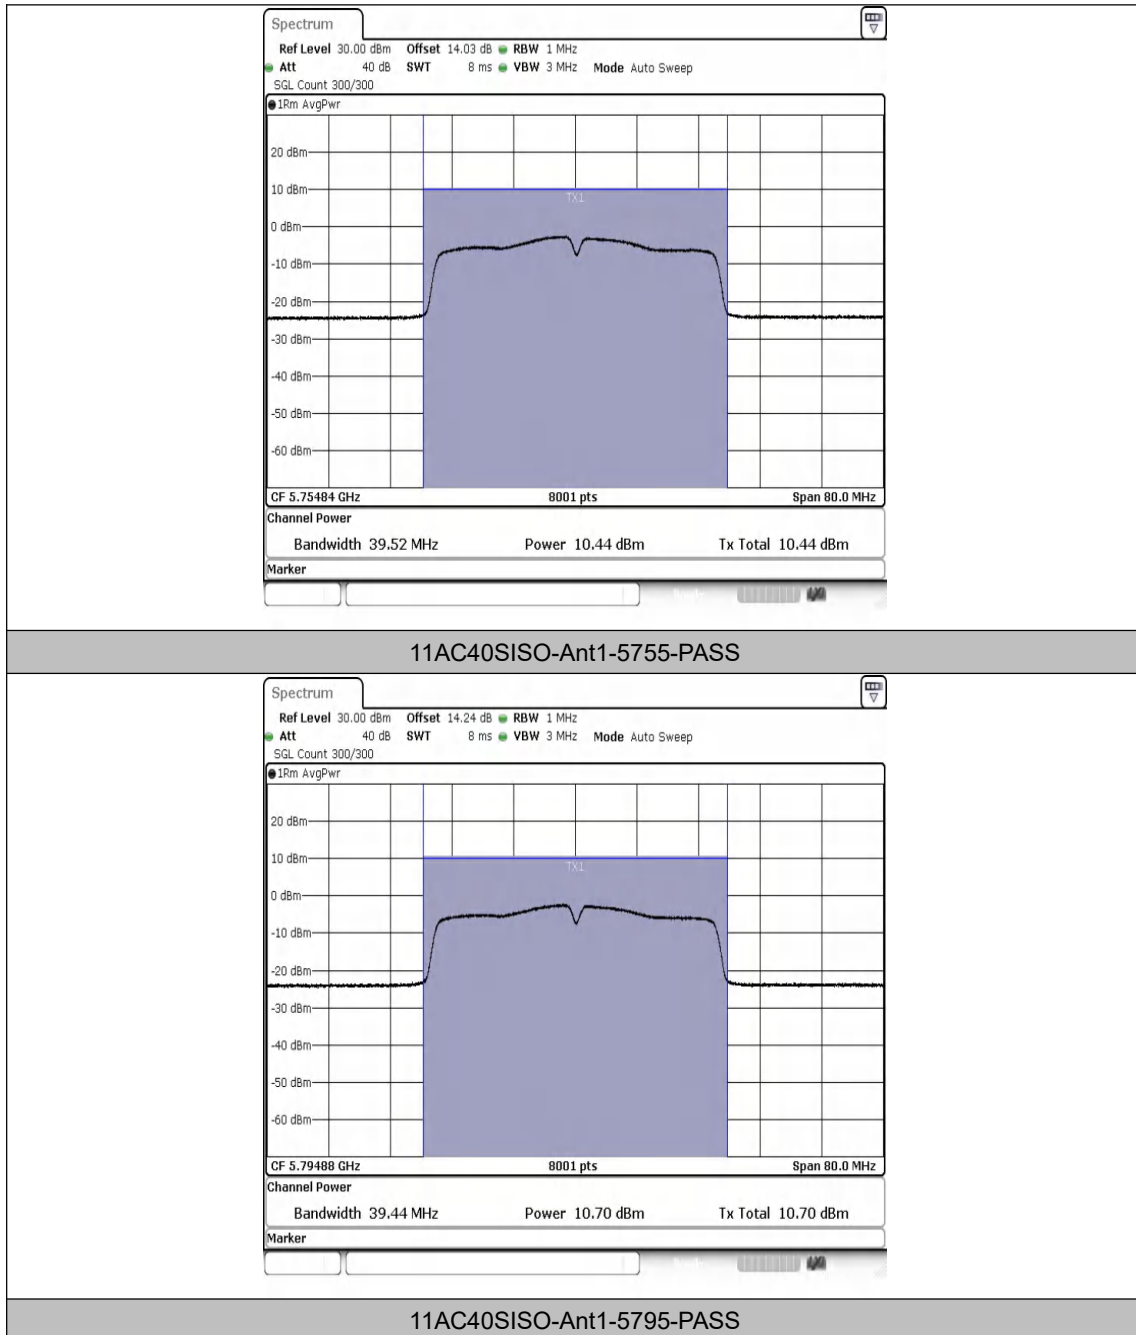


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
 400-003-0500
www.anbotek.com



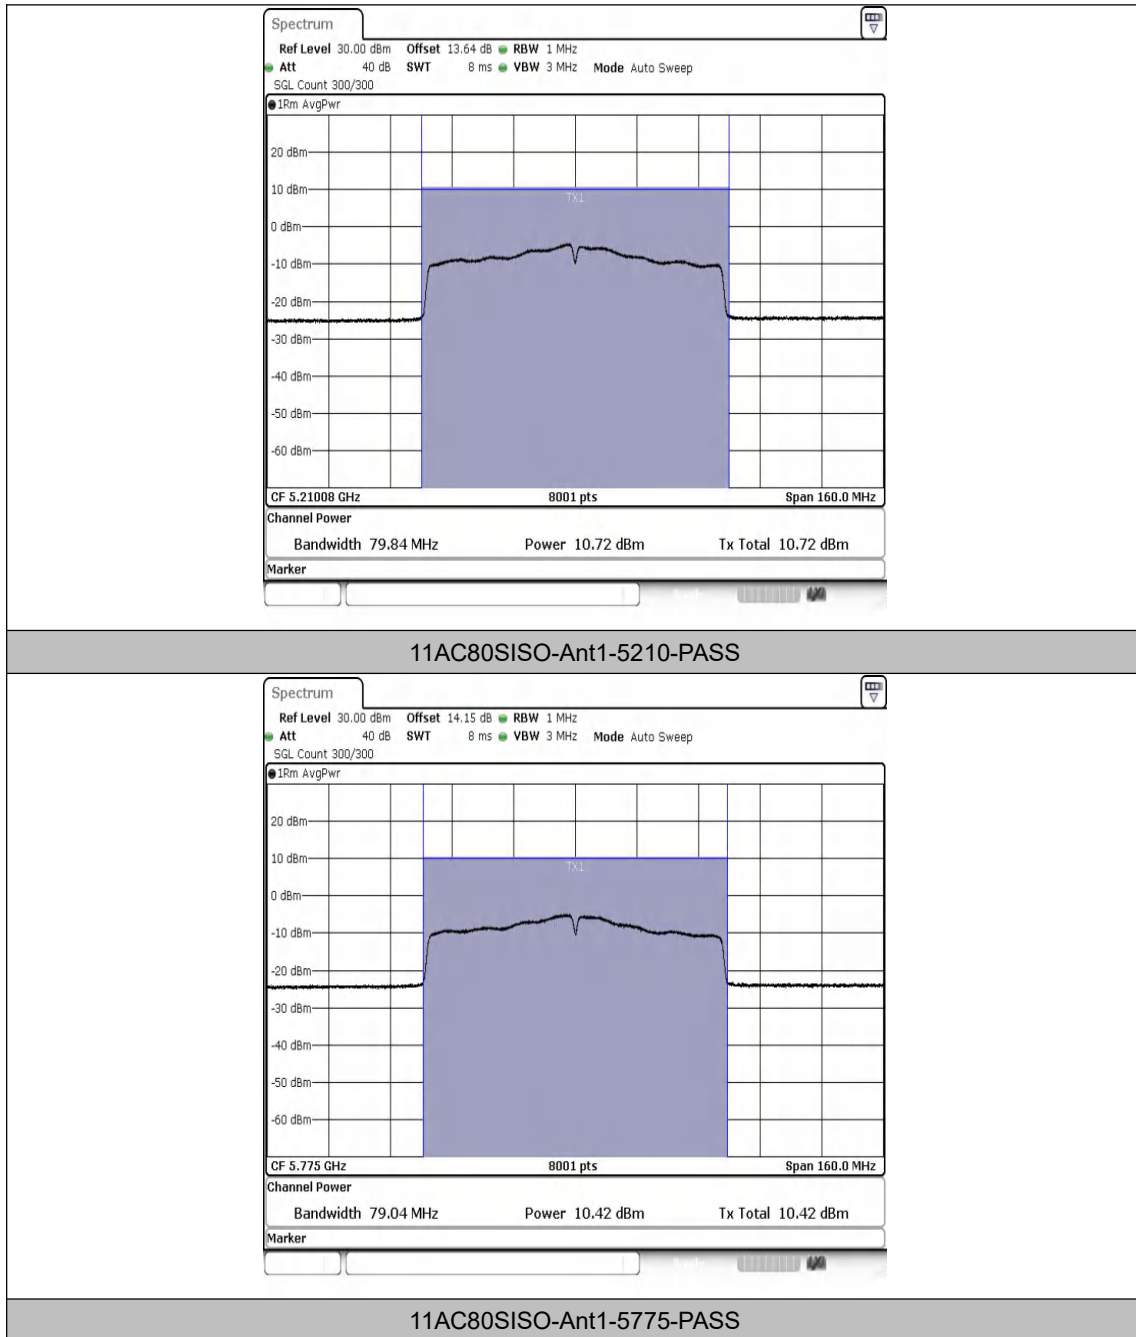

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



Appendix D: Maximum power spectral density

Test Result B1

TestMode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm/MHz]	Verdict
11A	Ant1	5180	0.76	0.02	0.78	≤11.00	PASS
11A	Ant1	5200	1.08	0.04	1.12	≤11.00	PASS
11A	Ant1	5240	1.1	0.04	1.14	≤11.00	PASS
11N20SISO	Ant1	5180	0.98	0.00	0.98	≤11.00	PASS
11N20SISO	Ant1	5200	0.88	0.00	0.88	≤11.00	PASS
11N20SISO	Ant1	5240	0.88	0.00	0.88	≤11.00	PASS
11N40SISO	Ant1	5190	-2.04	0.00	-2.04	≤11.00	PASS
11N40SISO	Ant1	5230	-1.74	0.00	-1.74	≤11.00	PASS
11AC20SISO	Ant1	5180	0.86	0.00	0.86	≤11.00	PASS
11AC20SISO	Ant1	5200	-0.03	0.00	-0.03	≤11.00	PASS
11AC20SISO	Ant1	5240	1.14	0.00	1.14	≤11.00	PASS
11AC40SISO	Ant1	5190	-2.19	0.00	-2.19	≤11.00	PASS
11AC40SISO	Ant1	5230	-1.34	0.00	-1.34	≤11.00	PASS
11AC80SISO	Ant1	5210	-4.51	0.00	-4.51	≤11.00	PASS

Note: 1.The cable loss are compensated in the graph.




Test Result B4

TestMode	Antenna	Frequenc y[MHz]	Reading Result [dBm/500 KHz]	DC Factor [dB]	Result [dBm/500 kHz]	Limit [dBm/500 kHz]	Verdict
11A	Ant1	5745	-1.36	0.04	-1.32	≤30.00	PASS
11A	Ant1	5785	-1.54	0.02	-1.52	≤30.00	PASS
11A	Ant1	5825	-1.38	0.04	-1.34	≤30.00	PASS
11N20SIS O	Ant1	5745	-2.23	0.00	-2.23	≤30.00	PASS
11N20SIS O	Ant1	5785	-2.53	0.00	-2.53	≤30.00	PASS
11N20SIS O	Ant1	5825	-1.87	0.00	-1.87	≤30.00	PASS
11N40SIS O	Ant1	5755	-4.45	0.00	-4.45	≤30.00	PASS
11N40SIS O	Ant1	5795	-5.5	0.00	-5.50	≤30.00	PASS
11AC20SI SO	Ant1	5745	-3.11	0.00	-3.11	≤30.00	PASS
11AC20SI SO	Ant1	5785	-3.18	0.00	-3.18	≤30.00	PASS
11AC20SI SO	Ant1	5825	-2.62	0.00	-2.62	≤30.00	PASS
11AC40SI SO	Ant1	5755	-5.05	0.00	-5.05	≤30.00	PASS
11AC40SI SO	Ant1	5795	-5.23	0.00	-5.23	≤30.00	PASS
11AC80SI SO	Ant1	5775	-8.11	0.00	-8.11	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.



Test Graphs

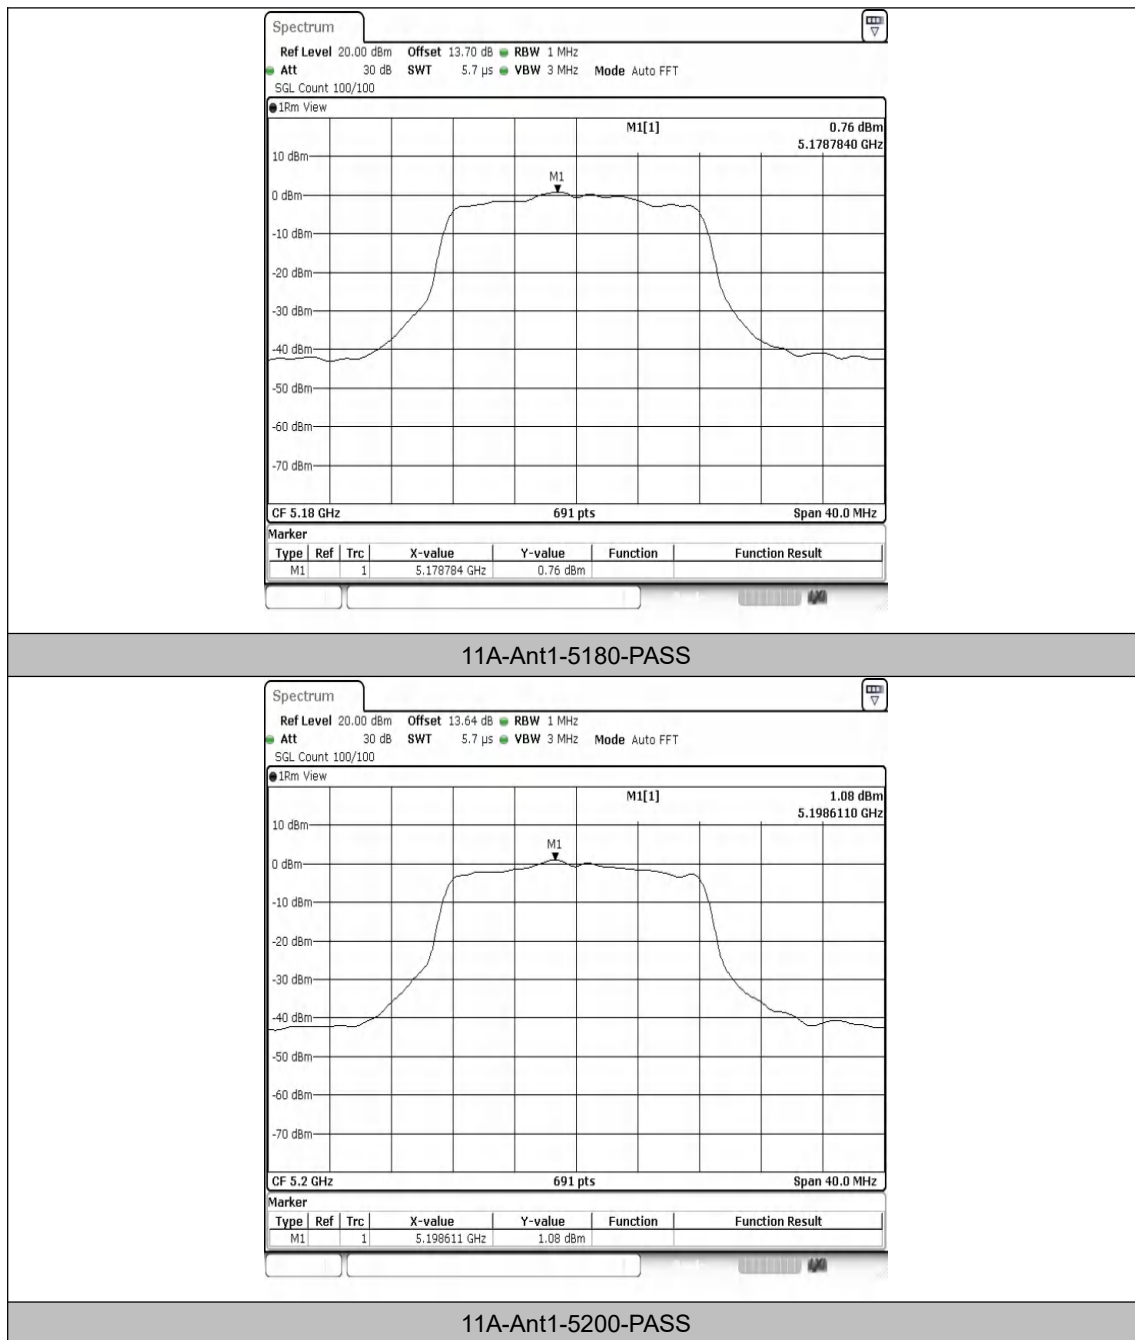


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



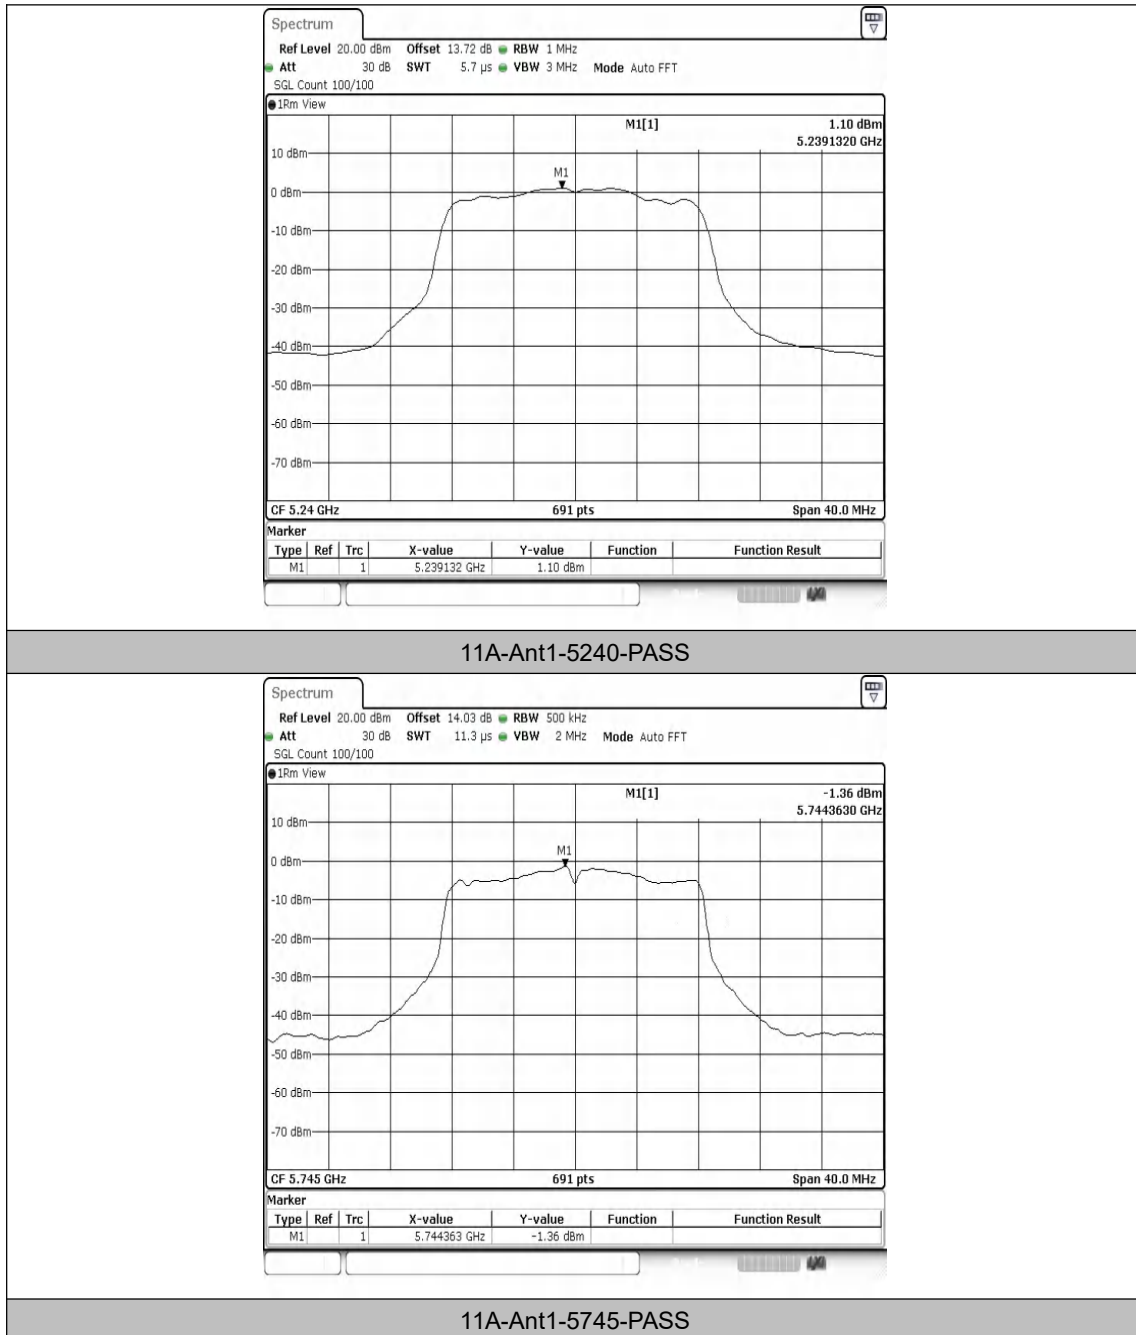



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
 400-003-0500
www.anbotek.com




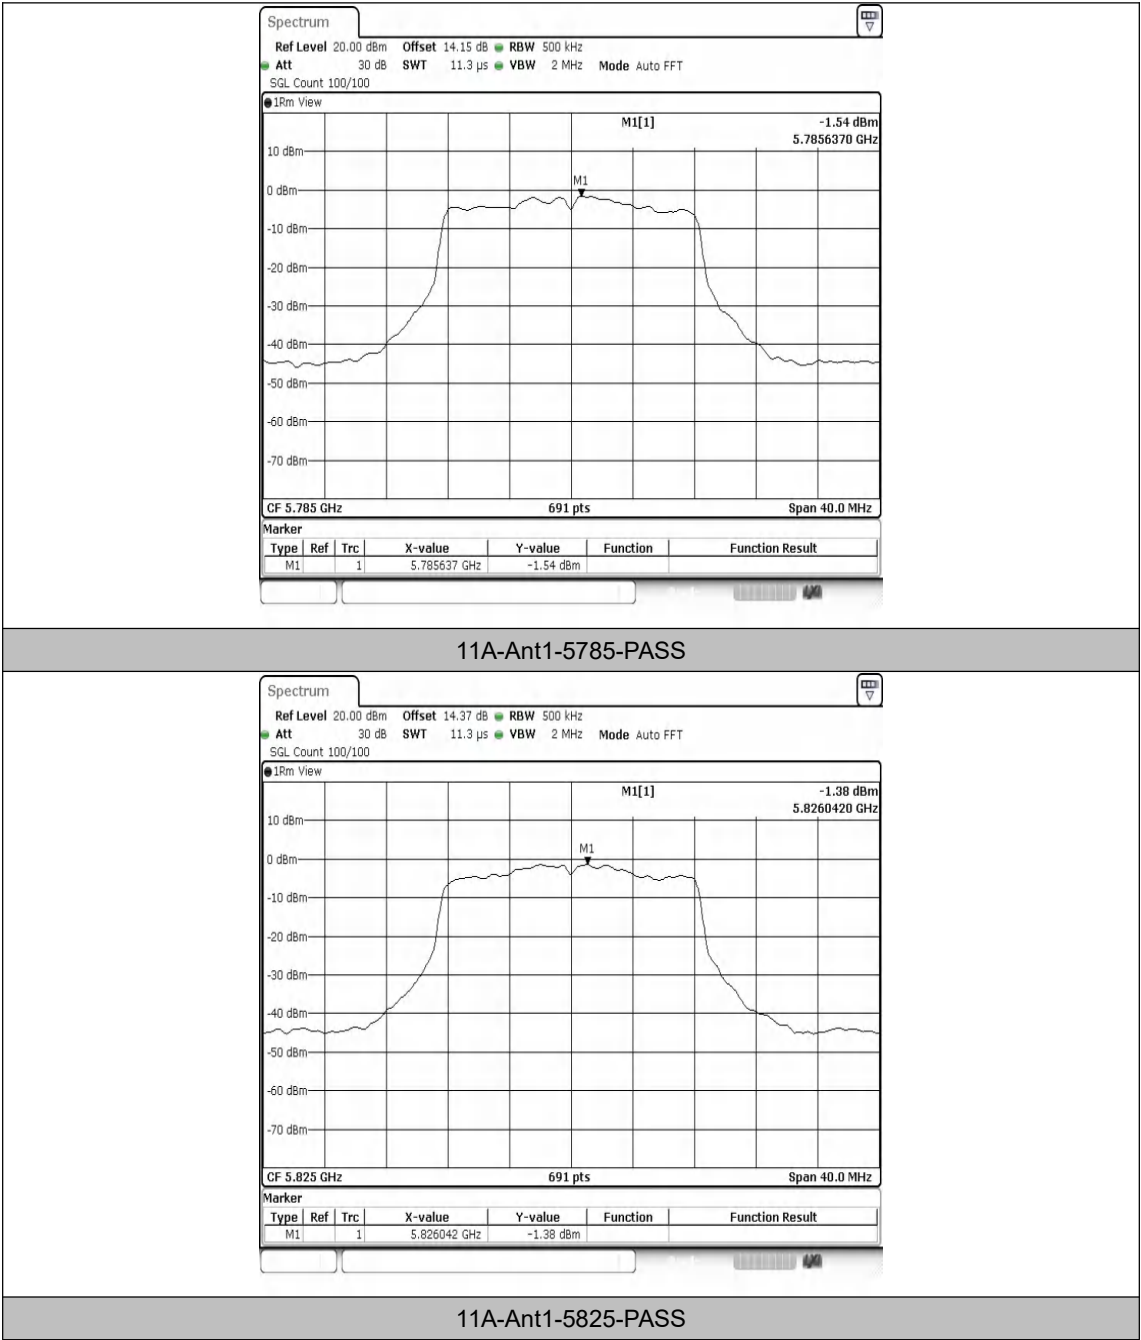


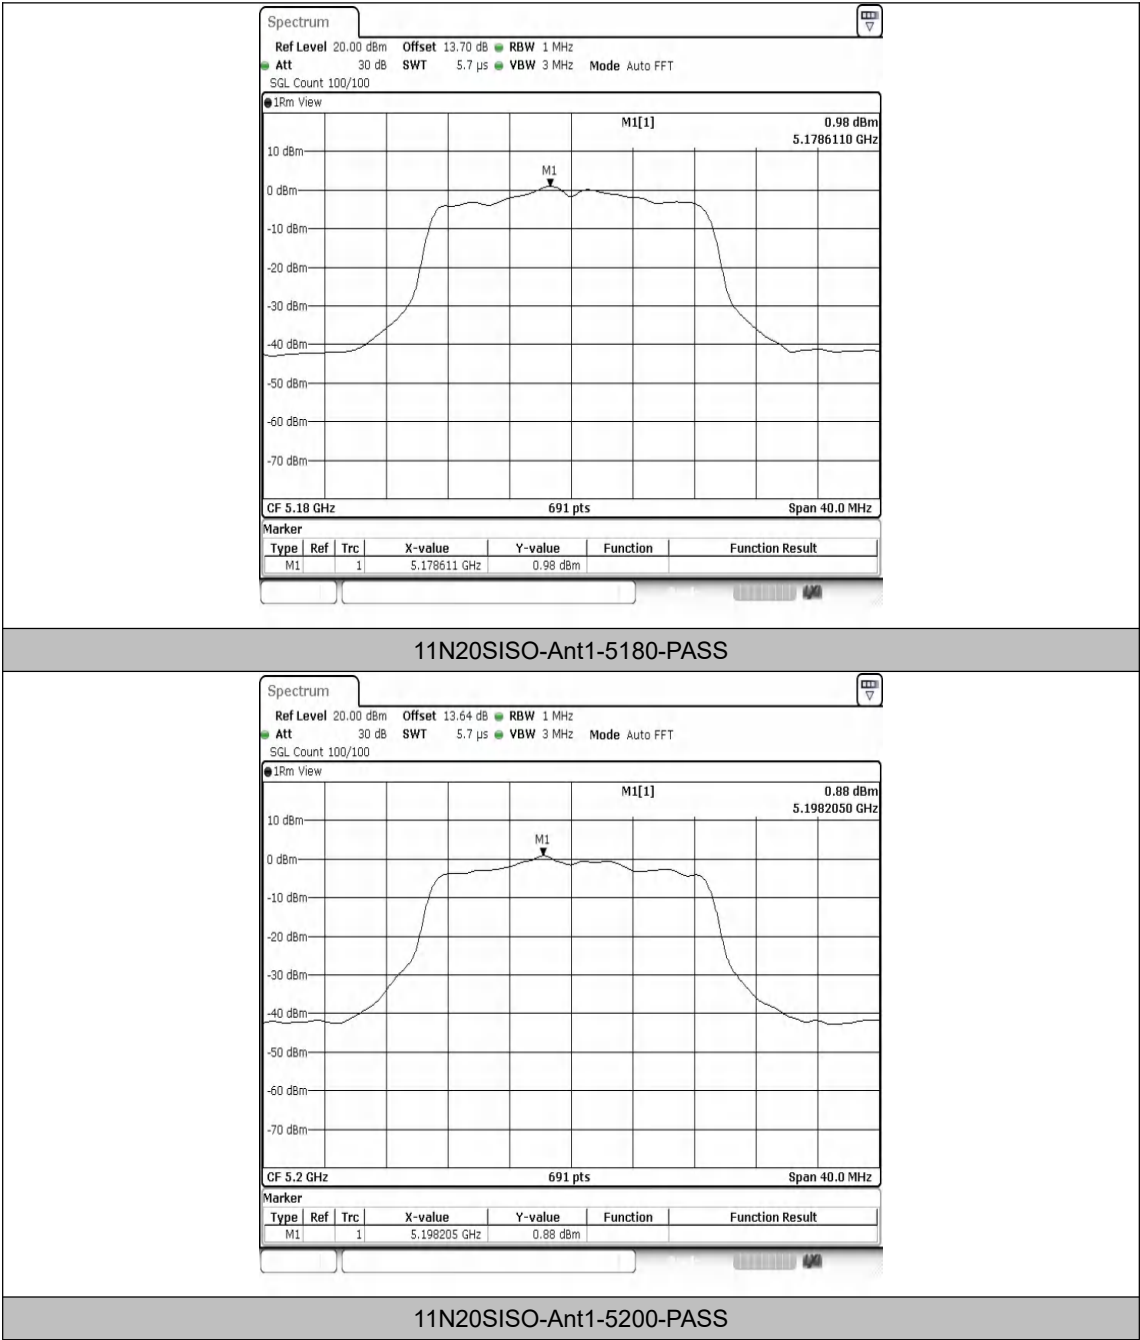

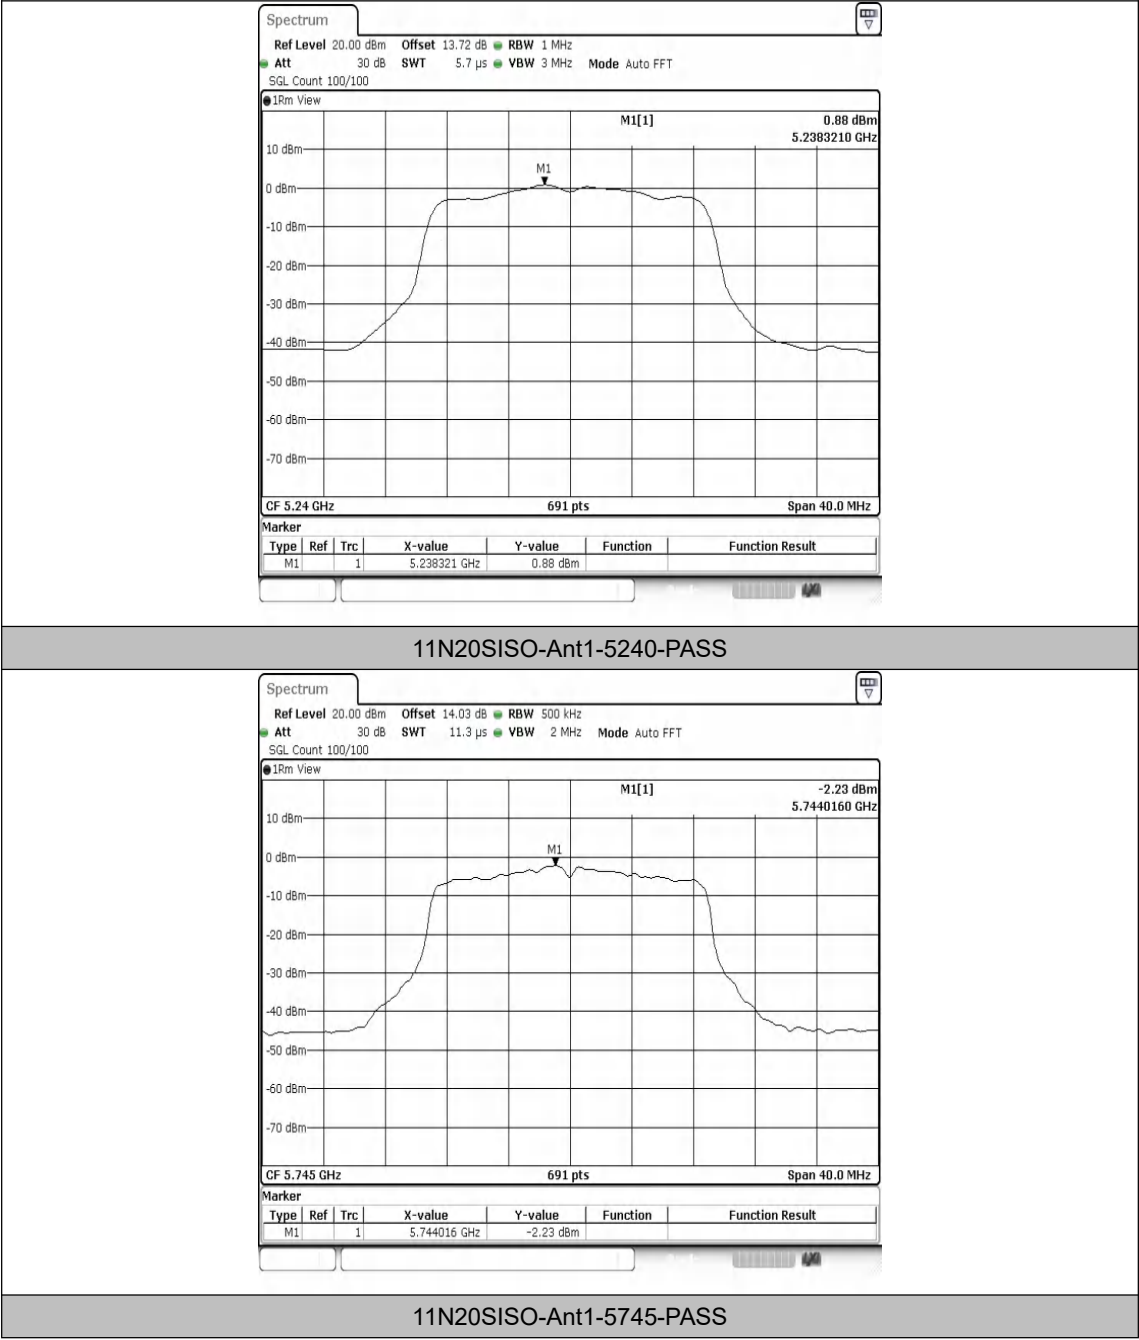

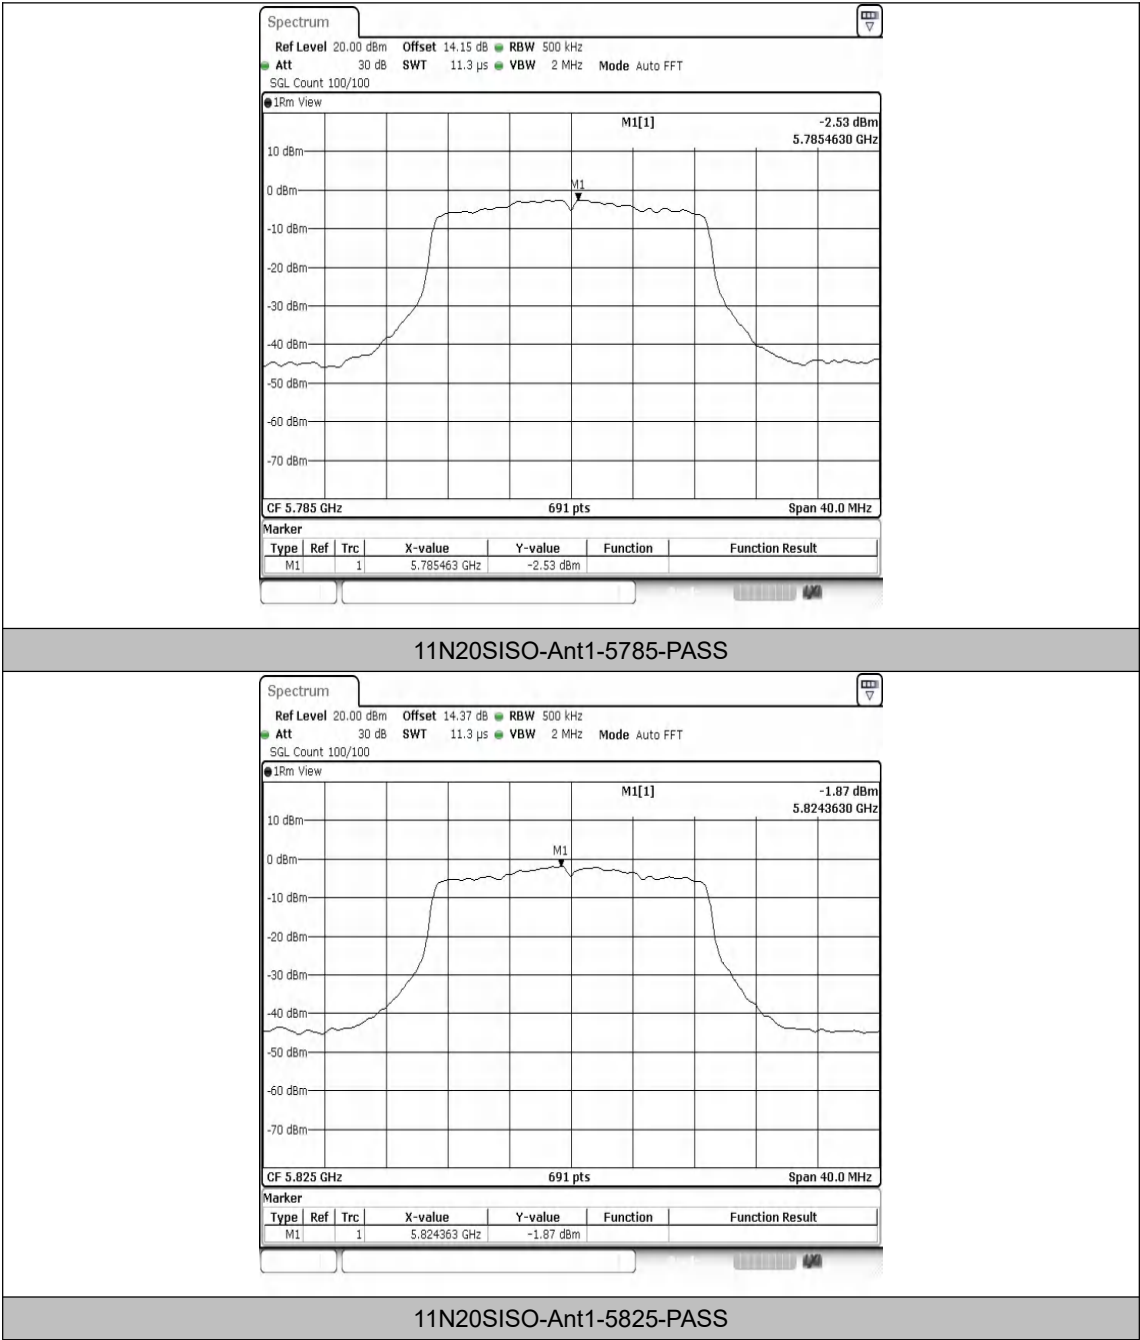

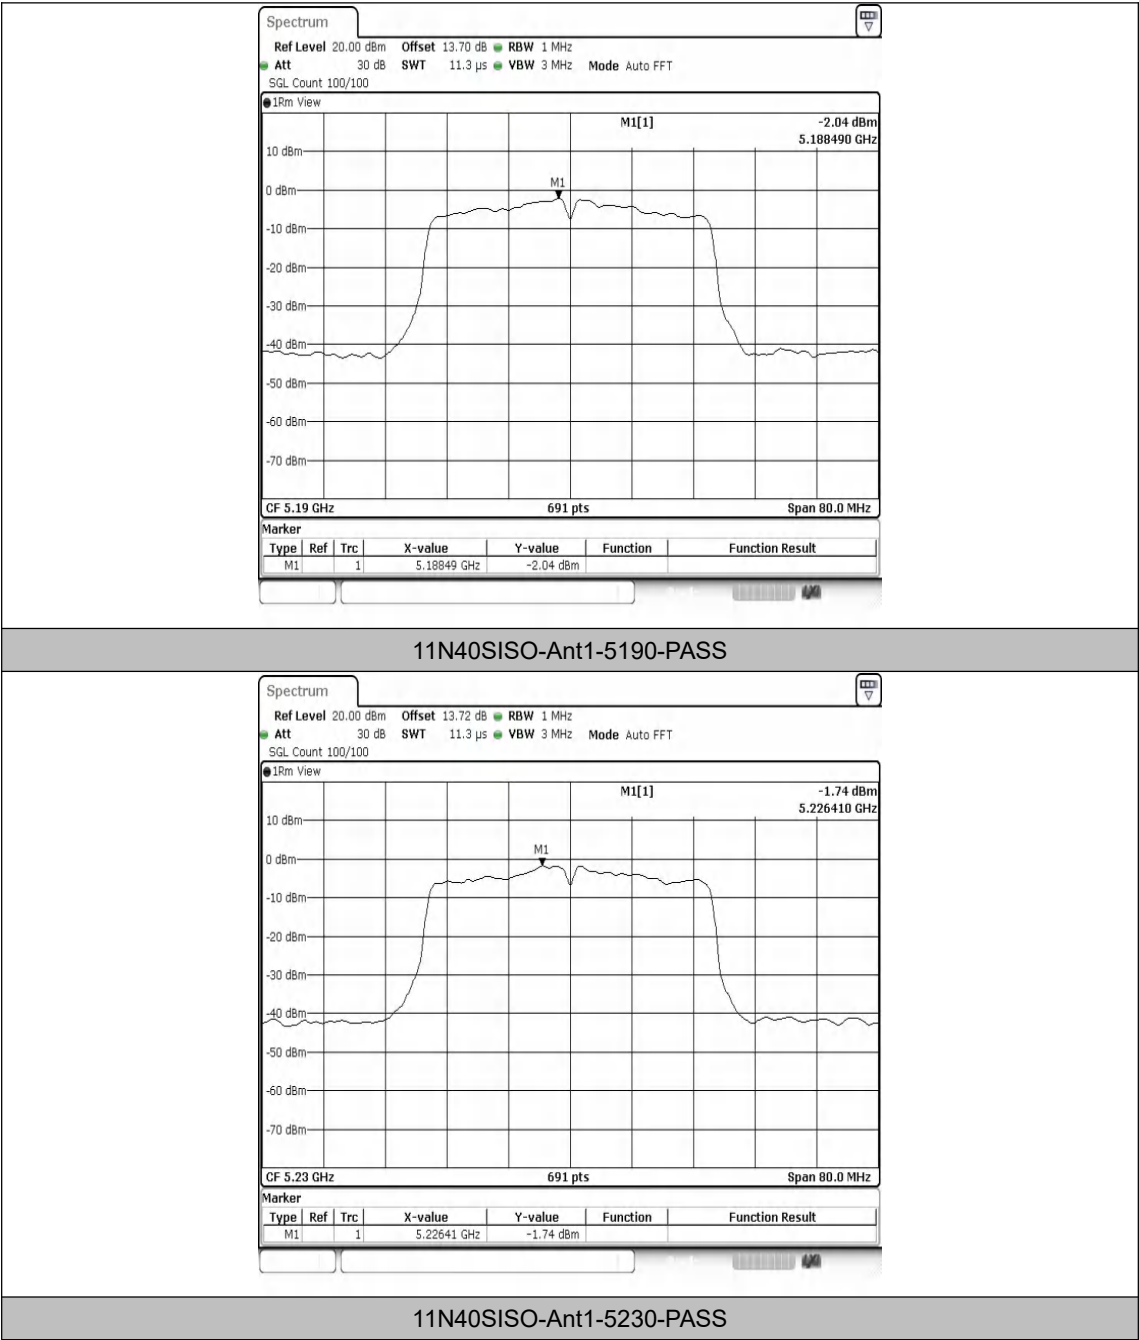

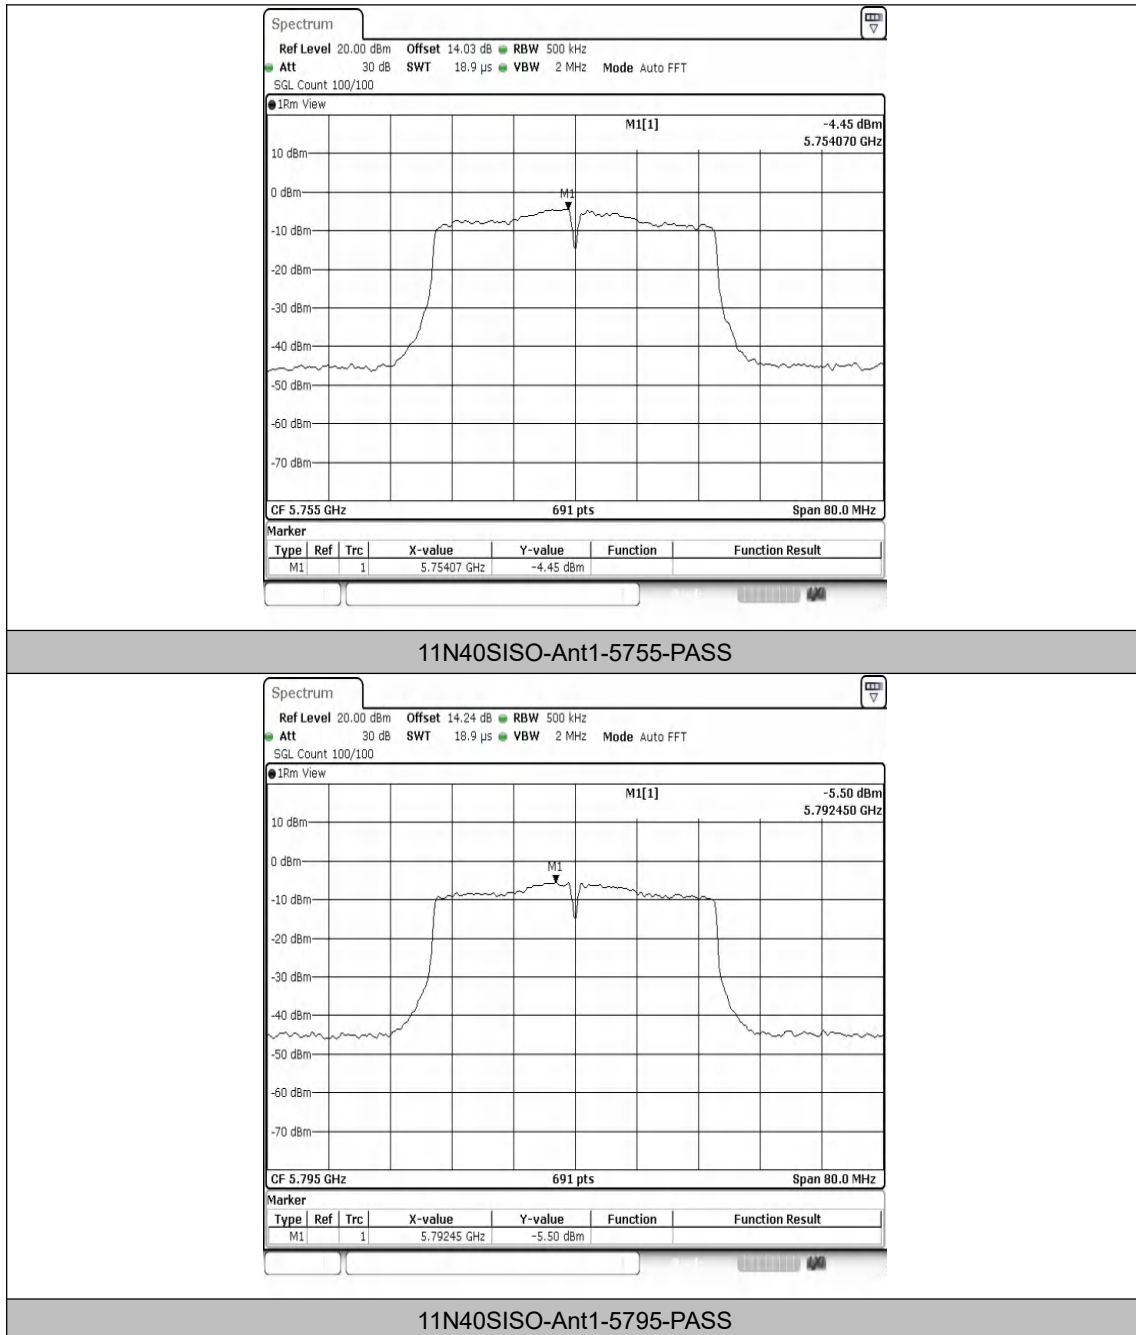



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com




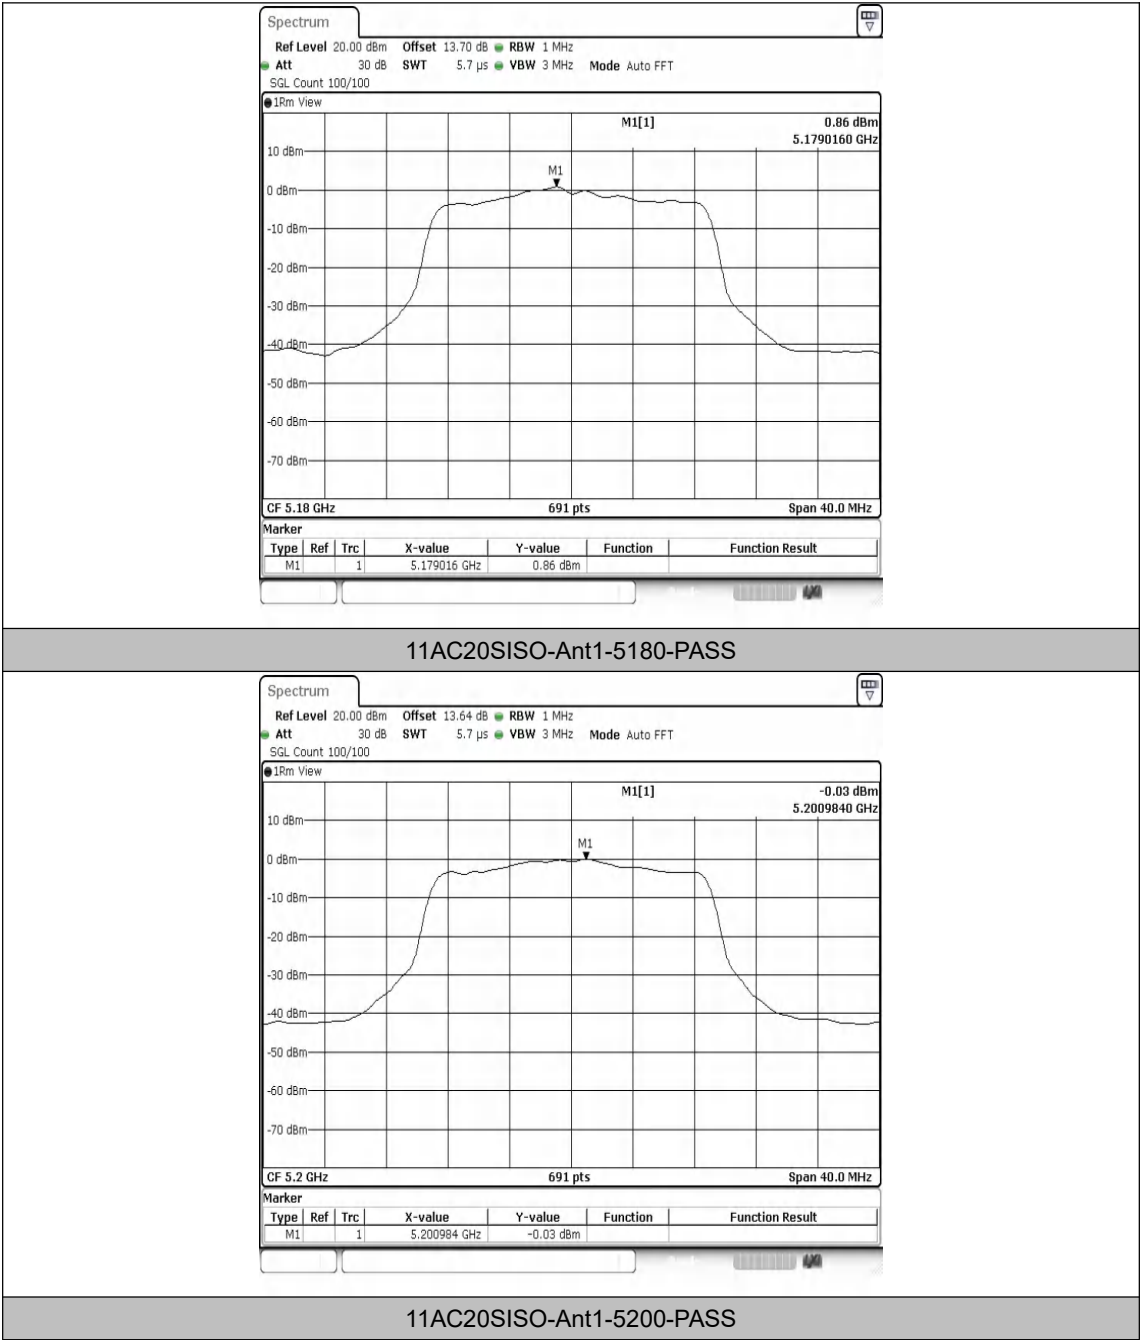


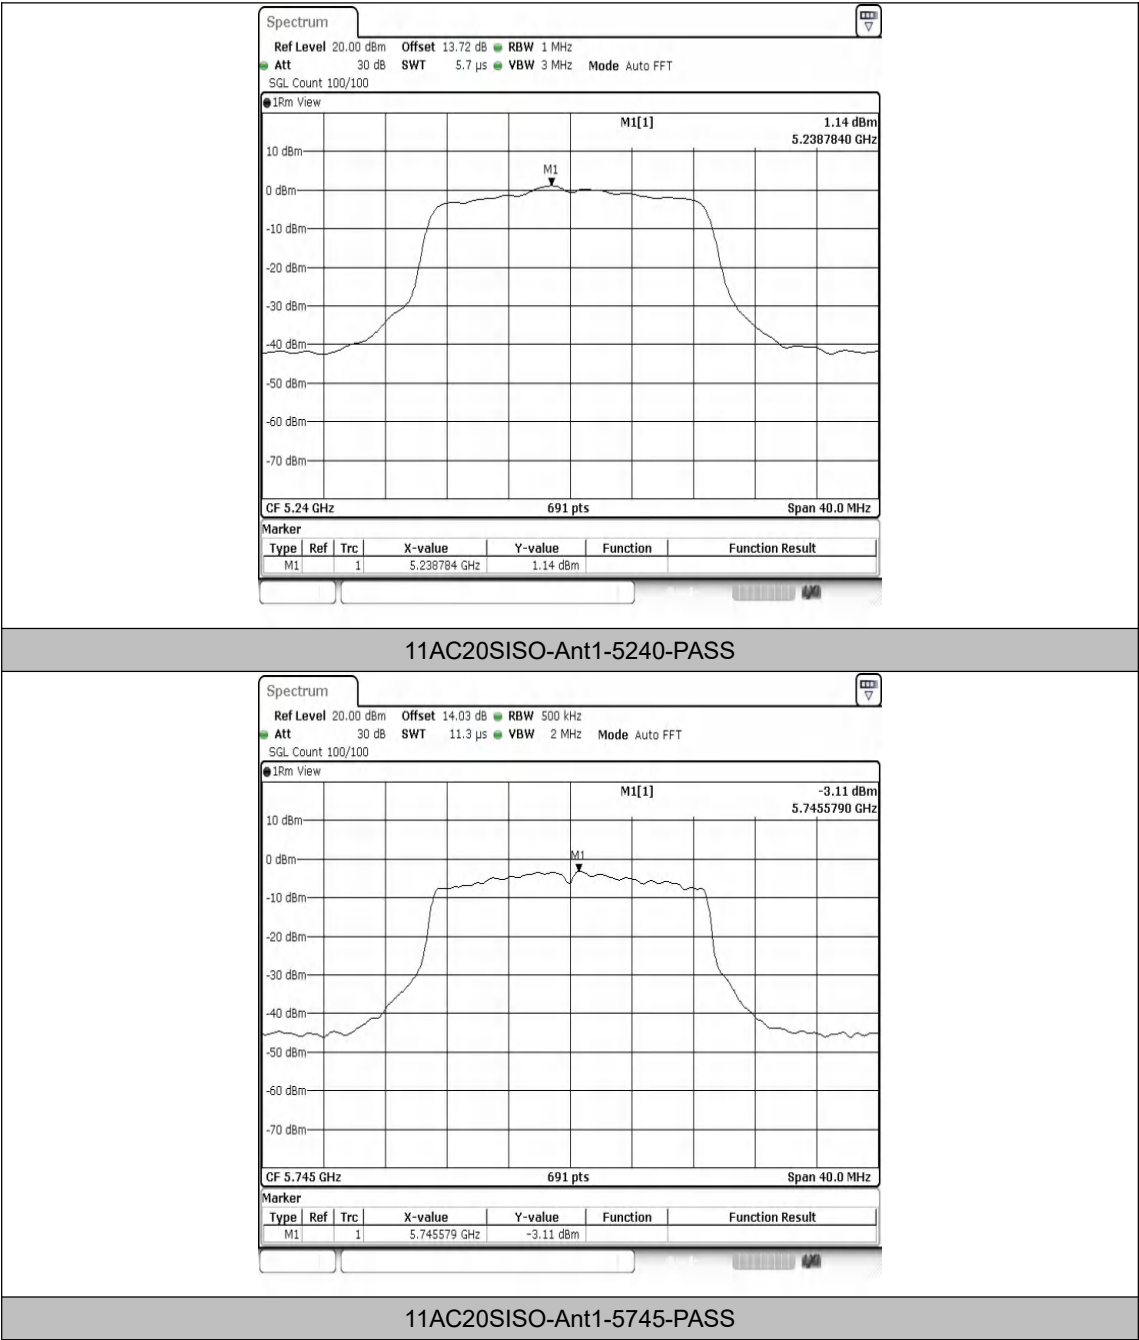

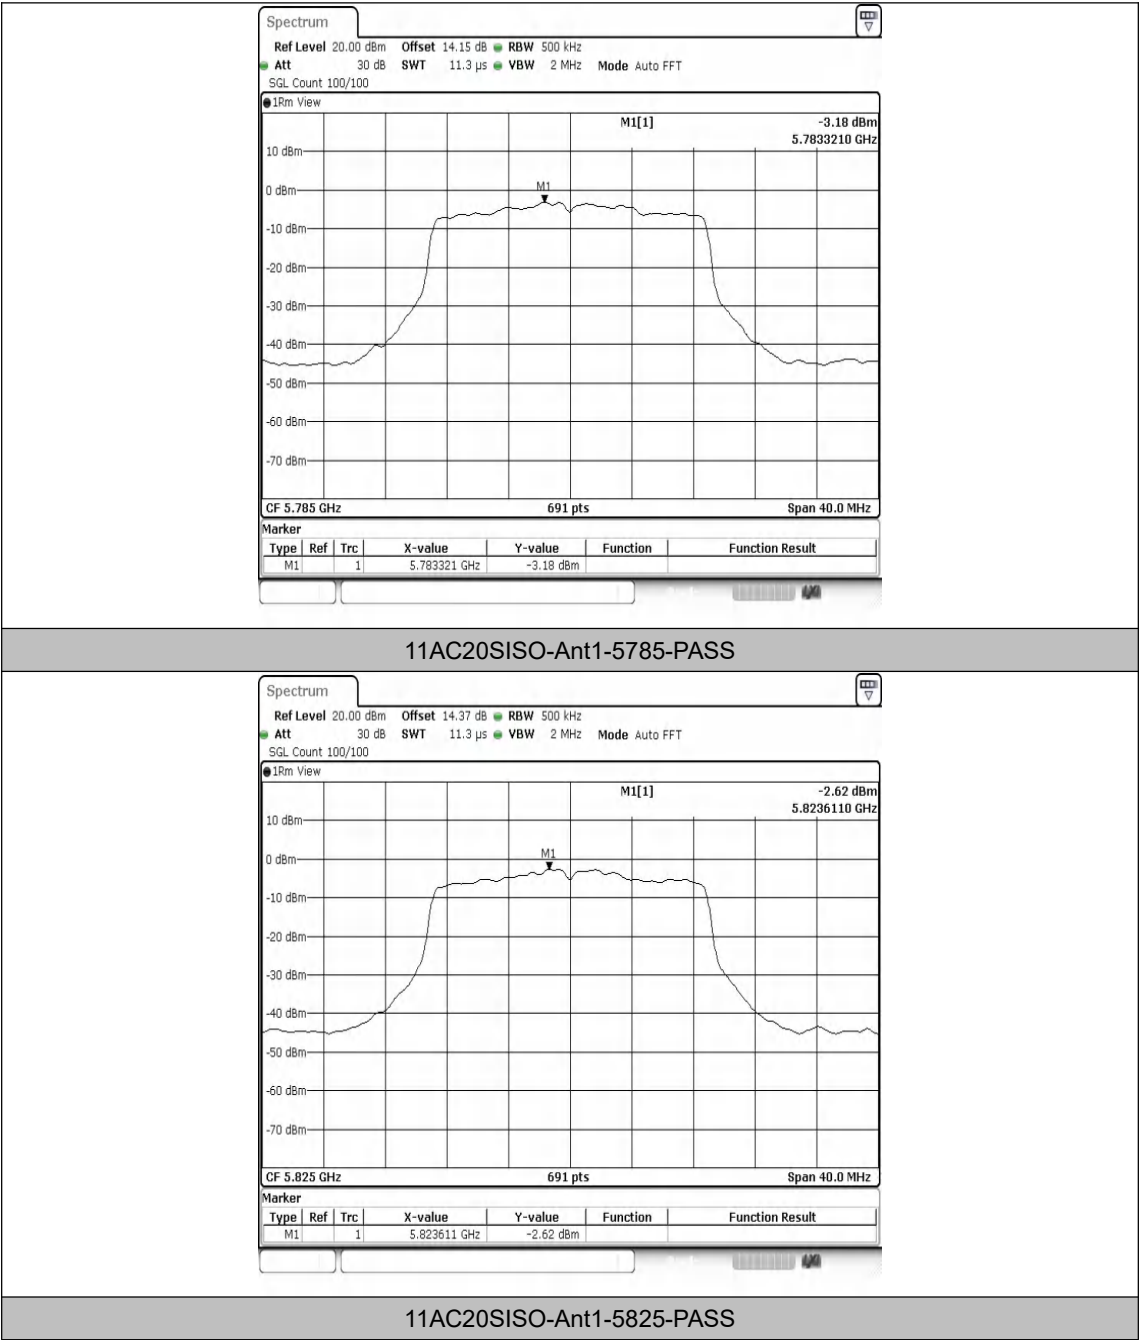

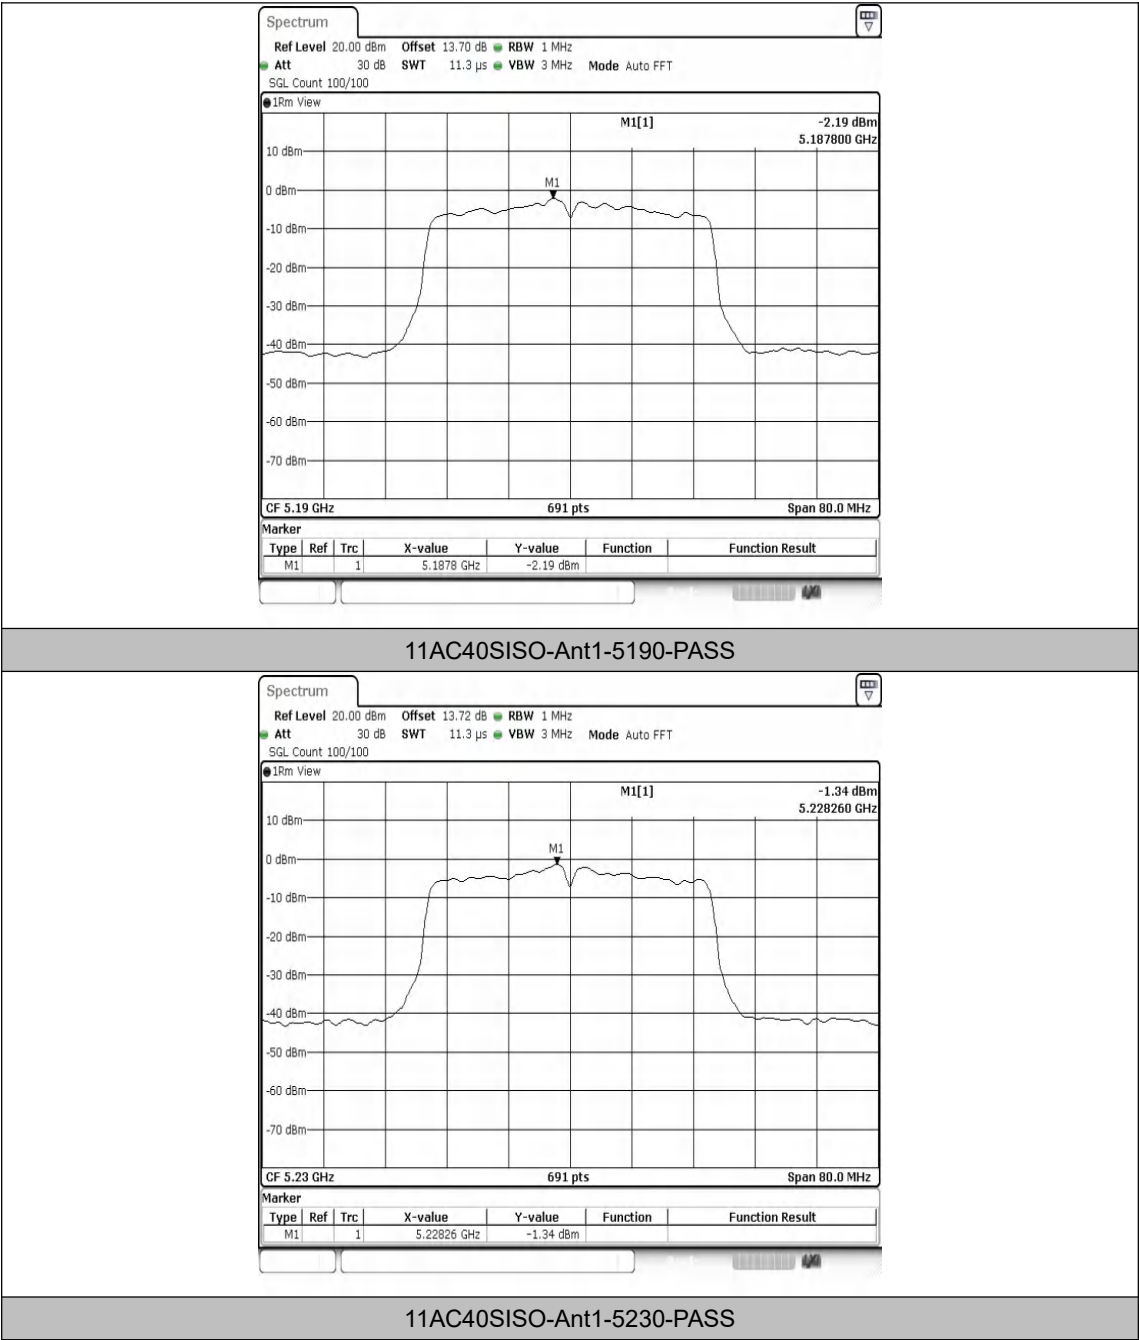

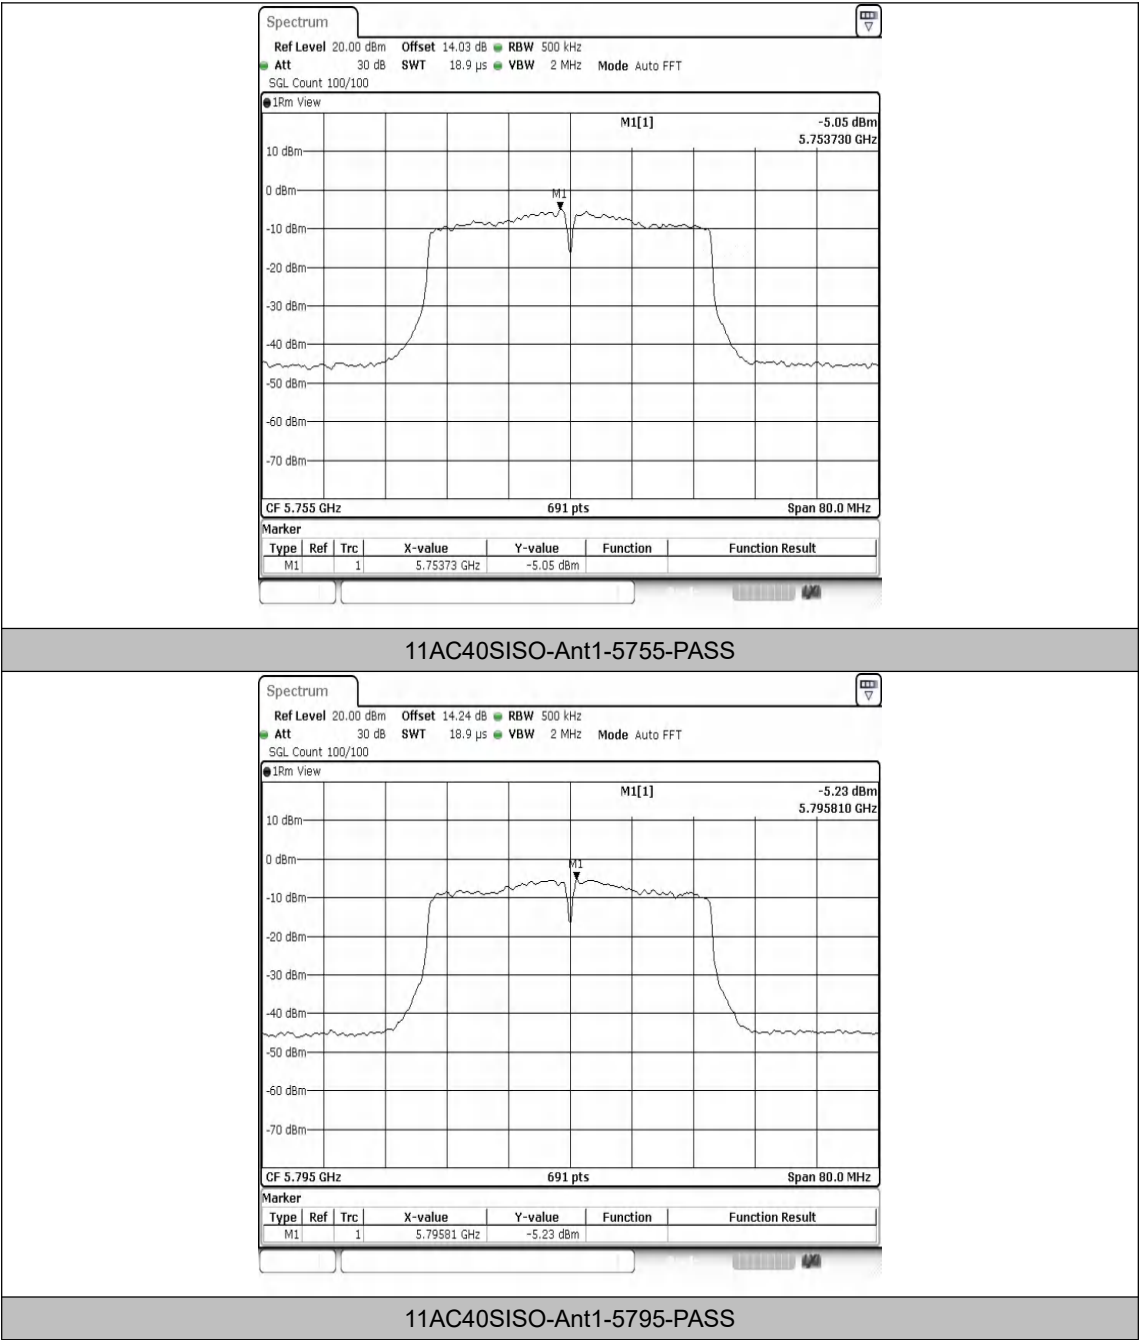

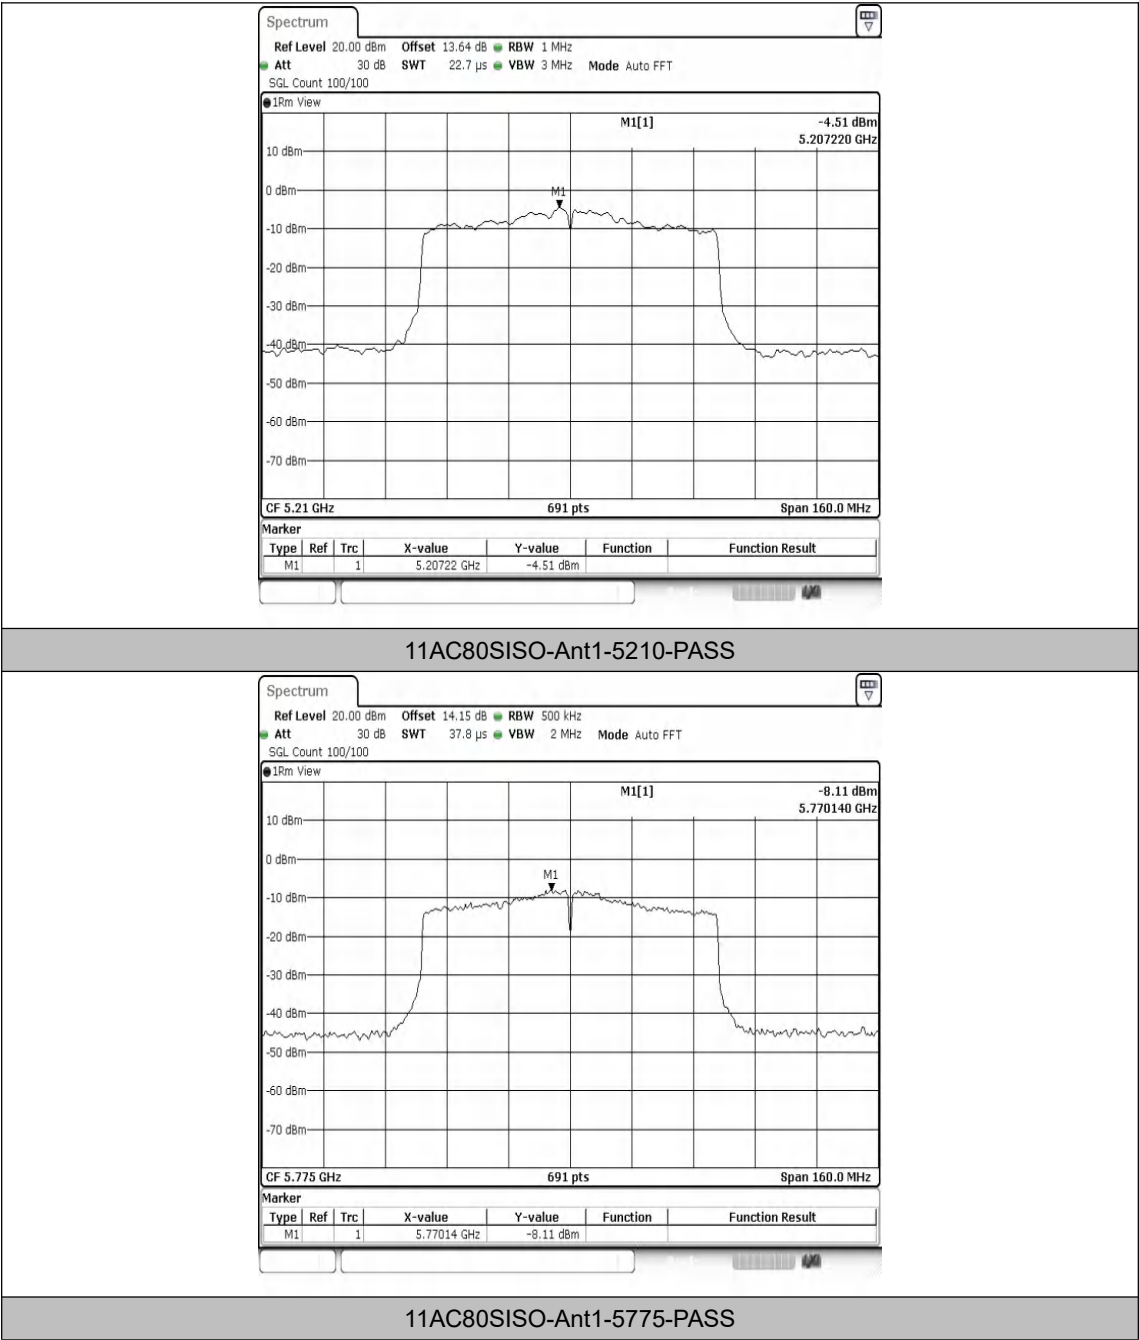

Appendix E: Band edge measurements

Test Result B1/2/3

TestMode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-31.11	≤-27	PASS
11A	Ant1	High	5240	-45.91	≤-27	PASS
11N20SISO	Ant1	Low	5180	-31.6	≤-27	PASS
11N20SISO	Ant1	High	5240	-46.03	≤-27	PASS
11N40SISO	Ant1	Low	5190	-28.36	≤-27	PASS
11N40SISO	Ant1	High	5230	-40.73	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-31.08	≤-27	PASS
11AC20SISO	Ant1	High	5240	-46.3	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-32.51	≤-27	PASS
11AC40SISO	Ant1	High	5230	-40.49	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-37.07	≤-27	PASS
11AC80SISO	Ant1	High	5210	-29.93	≤-27	PASS

Note: The margin is at least greater than the antenna gain plus the cable loss.

Test Result B4

TestMode	Antenna	ChName	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-27.13	≤16.36	PASS
11A	Ant1	Low	5745	5700~5720	-28.4	≤15.60	PASS
11A	Ant1	Low	5745	5650~5700	-48.26	≤-26.88	PASS
11A	Ant1	Low	5745	5760~5650	-48.03	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-29.07	≤15.65	PASS
11A	Ant1	High	5825	5855~5875	-29.43	≤15.55	PASS
11A	Ant1	High	5825	5875~5925	-46.52	≤-26.58	PASS
11A	Ant1	High	5825	5925~5935	-46.01	≤-27	PASS
11N20SI SO	Ant1	Low	5745	5720~5725	-23.39	≤18.26	PASS
11N20SI SO	Ant1	Low	5745	5700~5720	-22.65	≤14.67	PASS
11N20SI SO	Ant1	Low	5745	5650~5700	-49.48	≤-26.75	PASS
11N20SI SO	Ant1	Low	5745	5760~5650	-46.77	≤-27	PASS
11N20SI SO	Ant1	High	5825	5850~5855	-27.59	≤15.65	PASS
11N20SI SO	Ant1	High	5825	5855~5875	-28.02	≤15.17	PASS



11N20SI SO	Ant1	High	5825	5875~5925	-46.83	≤-26.00	PASS
11N20SI SO	Ant1	High	5825	5925~5935	-46.72	≤-27	PASS
11N40SI SO	Ant1	Low	5755	5720~5725	-15.56	≤15.90	PASS
11N40SI SO	Ant1	Low	5755	5700~5720	-17.36	≤13.17	PASS
11N40SI SO	Ant1	Low	5755	5650~5700	-41.46	≤-26.21	PASS
11N40SI SO	Ant1	Low	5755	5780~5650	-41.92	≤-27	PASS
11N40SI SO	Ant1	High	5795	5850~5855	-23.72	≤19.12	PASS
11N40SI SO	Ant1	High	5795	5855~5875	-26.2	≤13.09	PASS
11N40SI SO	Ant1	High	5795	5875~5925	-42.51	≤-26.97	PASS
11N40SI SO	Ant1	High	5795	5925~5935	-40	≤-27	PASS
11AC20S ISO	Ant1	Low	5745	5720~5725	-19.89	≤20.92	PASS
11AC20S ISO	Ant1	Low	5745	5700~5720	-27.05	≤14.11	PASS
11AC20S ISO	Ant1	Low	5745	5650~5700	-48.19	≤-26.63	PASS
11AC20S ISO	Ant1	Low	5745	5760~5650	-47.16	≤-27	PASS
11AC20S ISO	Ant1	High	5825	5850~5855	-24.99	≤15.65	PASS
11AC20S ISO	Ant1	High	5825	5855~5875	-24.27	≤15.50	PASS
11AC20S ISO	Ant1	High	5825	5875~5925	-45.71	≤-24.99	PASS
11AC20S ISO	Ant1	High	5825	5925~5935	-46	≤-27	PASS
11AC40S ISO	Ant1	Low	5755	5720~5725	-13.84	≤15.90	PASS
11AC40S ISO	Ant1	Low	5755	5700~5720	-14.33	≤15.58	PASS
11AC40S ISO	Ant1	Low	5755	5650~5700	-42.9	≤-26.94	PASS
11AC40S	Ant1	Low	5755	5780~5650	-41.89	≤-27	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86)0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com





ISO							
11AC40S ISO	Ant1	High	5795	5850~5855	-25.95	≤15.85	PASS
11AC40S ISO	Ant1	High	5795	5855~5875	-25.53	≤15.56	PASS
11AC40S ISO	Ant1	High	5795	5875~5925	-42.67	≤-26.79	PASS
11AC40S ISO	Ant1	High	5795	5925~5935	-42.21	≤-27	PASS
11AC80S ISO	Ant1	Low	5775	5720~5725	-15.62	≤15.67	PASS
11AC80S ISO	Ant1	Low	5775	5700~5720	-14.4	≤14.04	PASS
11AC80S ISO	Ant1	Low	5775	5650~5700	-27.89	≤-24.88	PASS
11AC80S ISO	Ant1	Low	5775	5800~5650	-29.5	≤-27	PASS
11AC80S ISO	Ant1	High	5775	5850~5855	-19.21	≤16.59	PASS
11AC80S ISO	Ant1	High	5775	5855~5875	-20.66	≤10.02	PASS
11AC80S ISO	Ant1	High	5775	5875~5925	-34.64	≤-26.86	PASS
11AC80S ISO	Ant1	High	5775	5925~5935	-33.63	≤-27	PASS

Note: The margin is at least greater than the antenna gain plus the cable loss.




Test Graphs B1/2/3

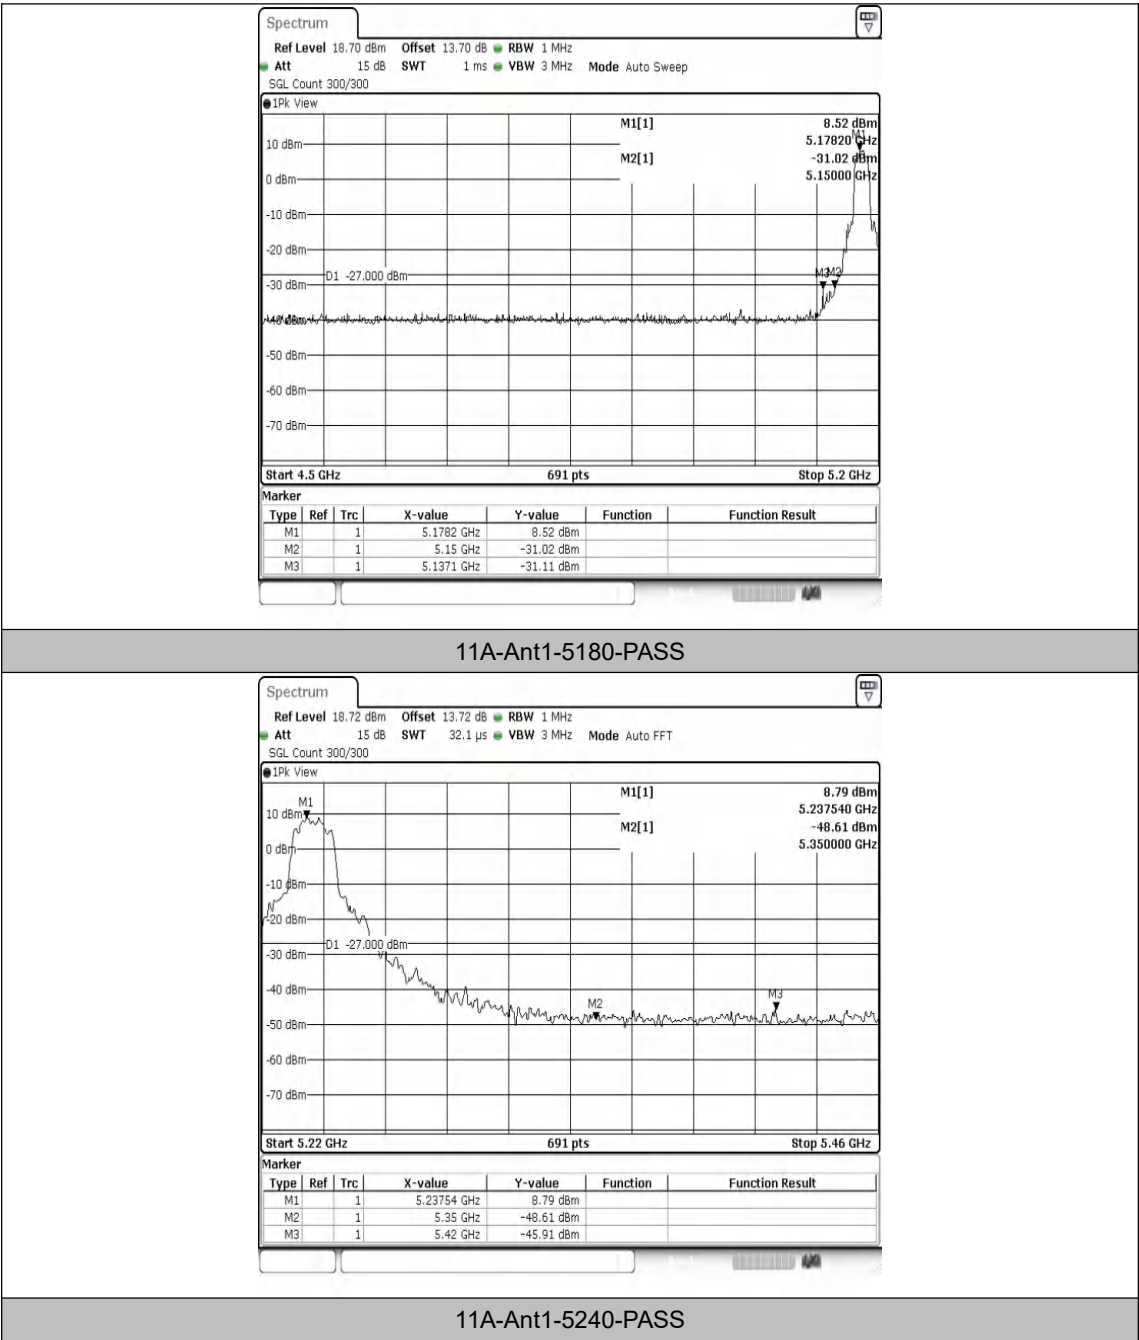

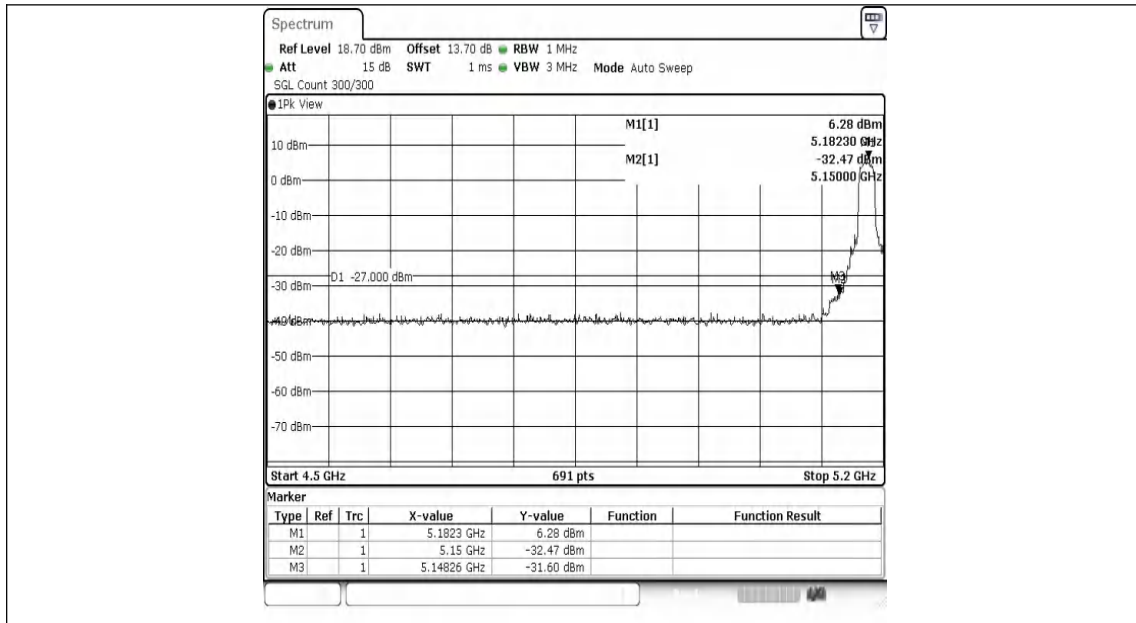


11N20SISO-Ant1-5180-PASS

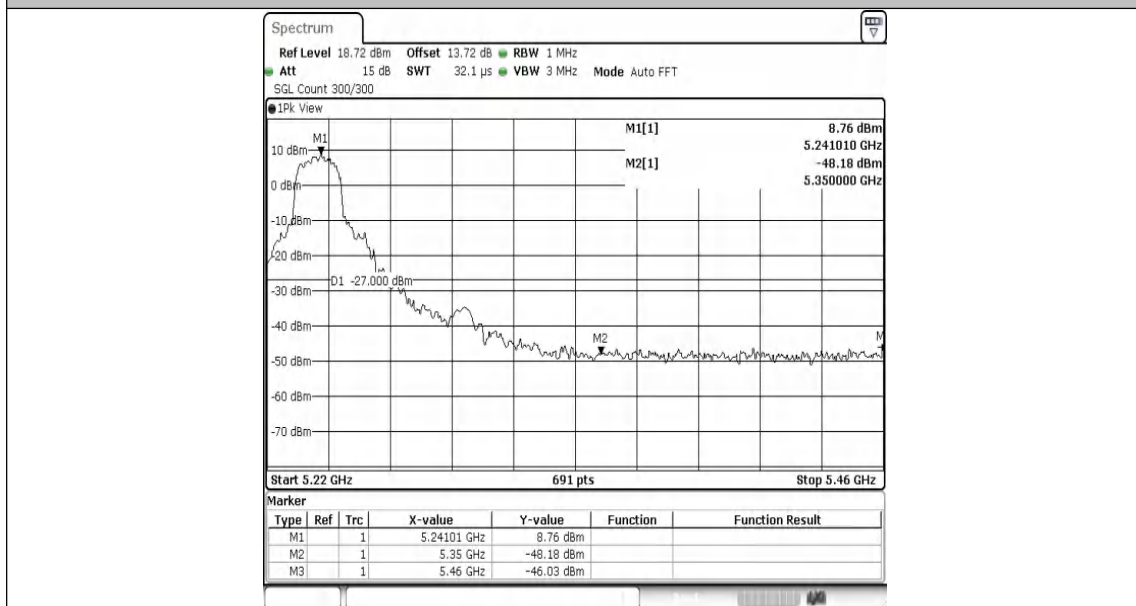


11N20SISO-Ant1-5240-PASS



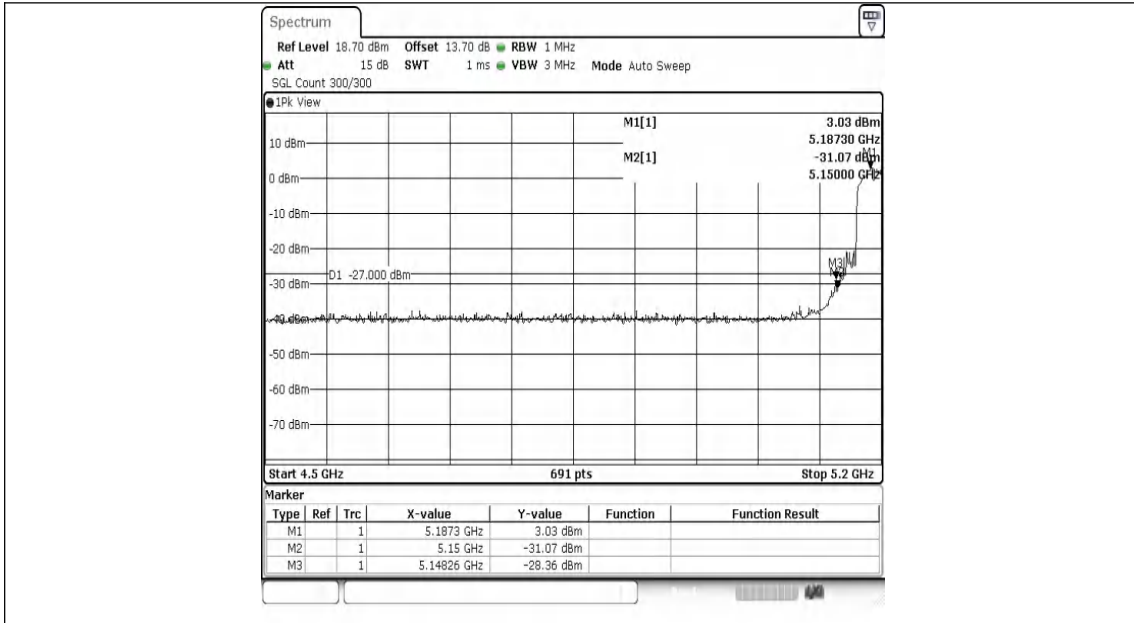


11N40SISO-Ant1-5190-PASS

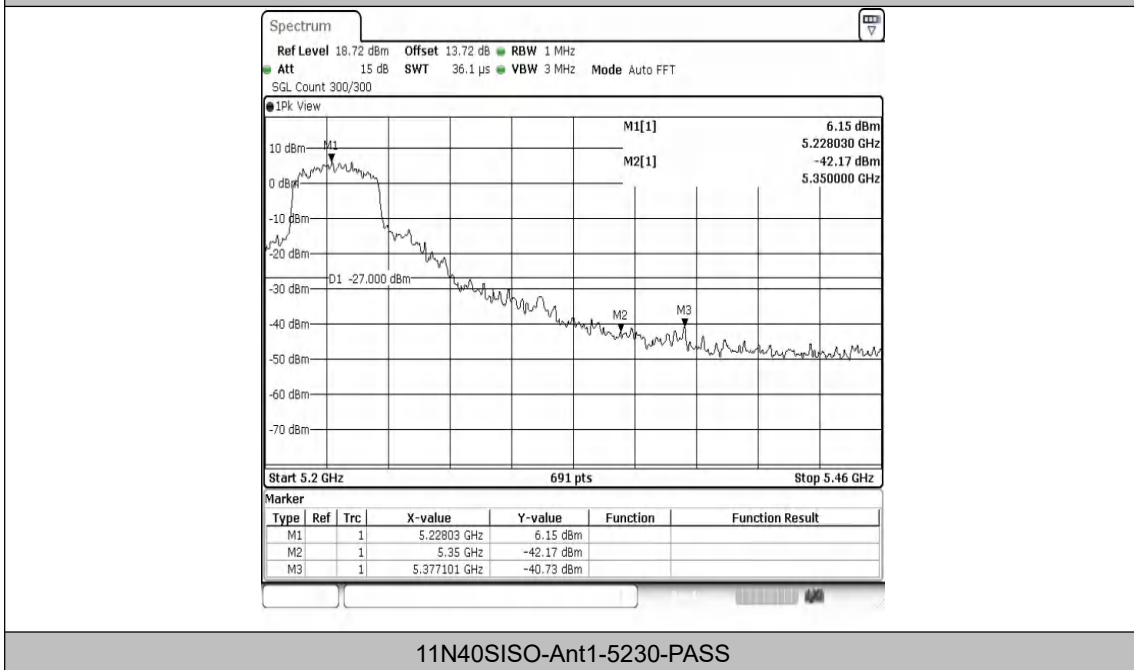


11N40SISO-Ant1-5230-PASS



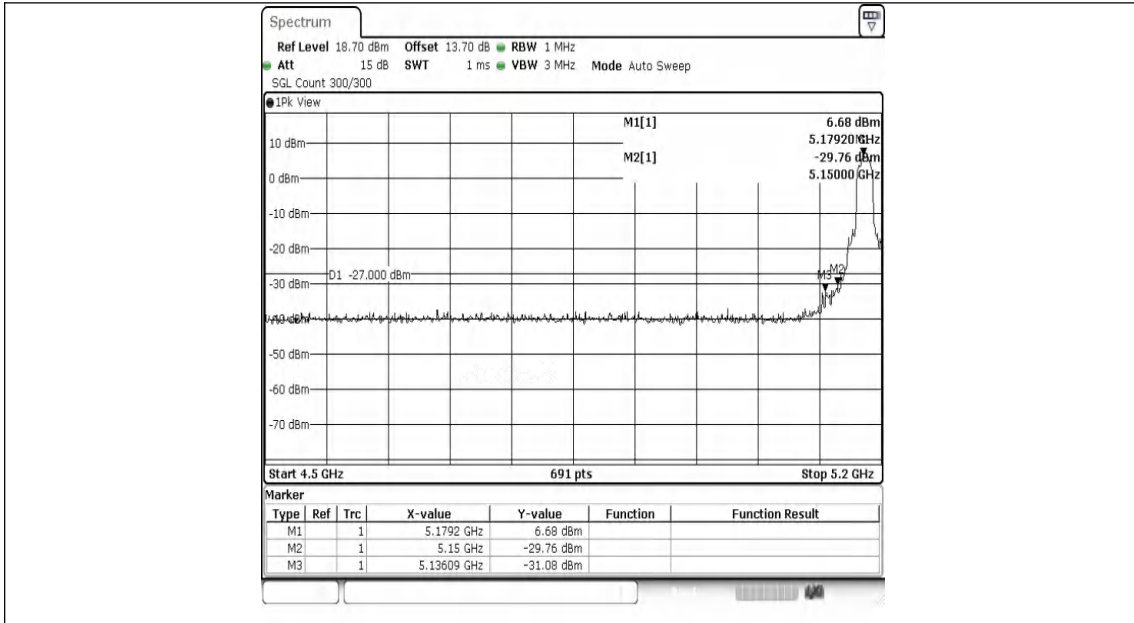


11AC20SISO-Ant1-5180-PASS

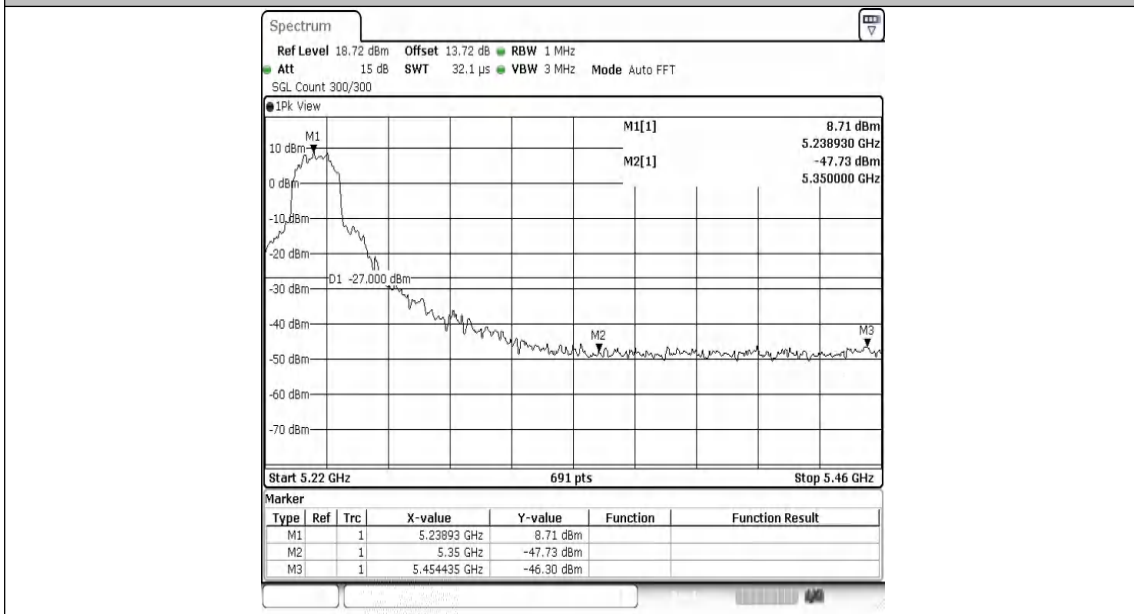


11AC20SISO-Ant1-5240-PASS



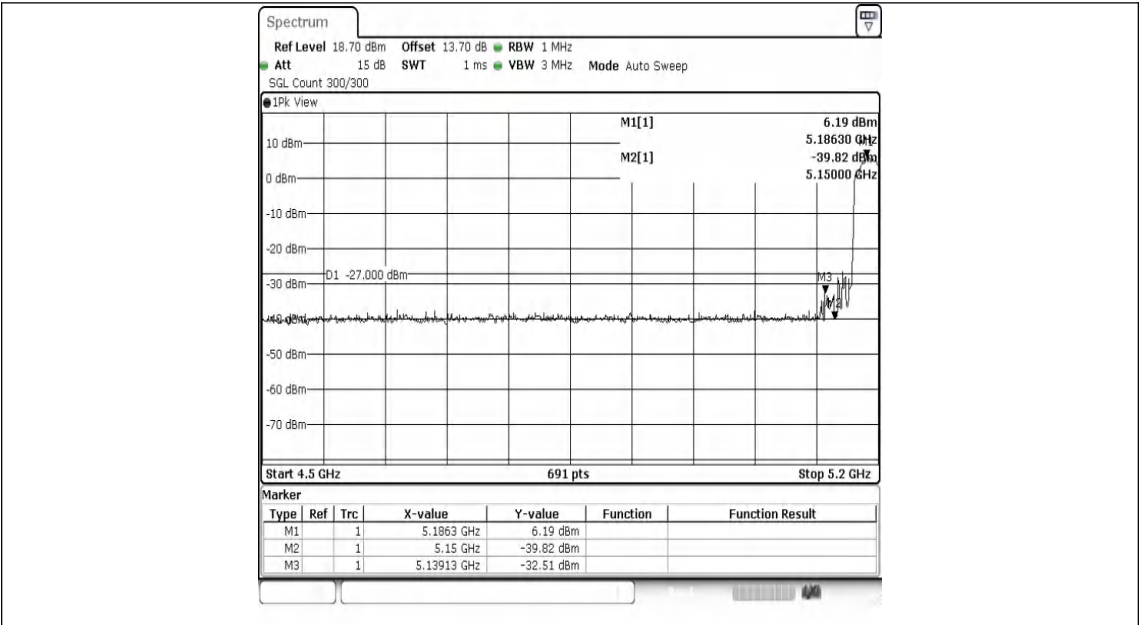


11AC40SISO-Ant1-5190-PASS

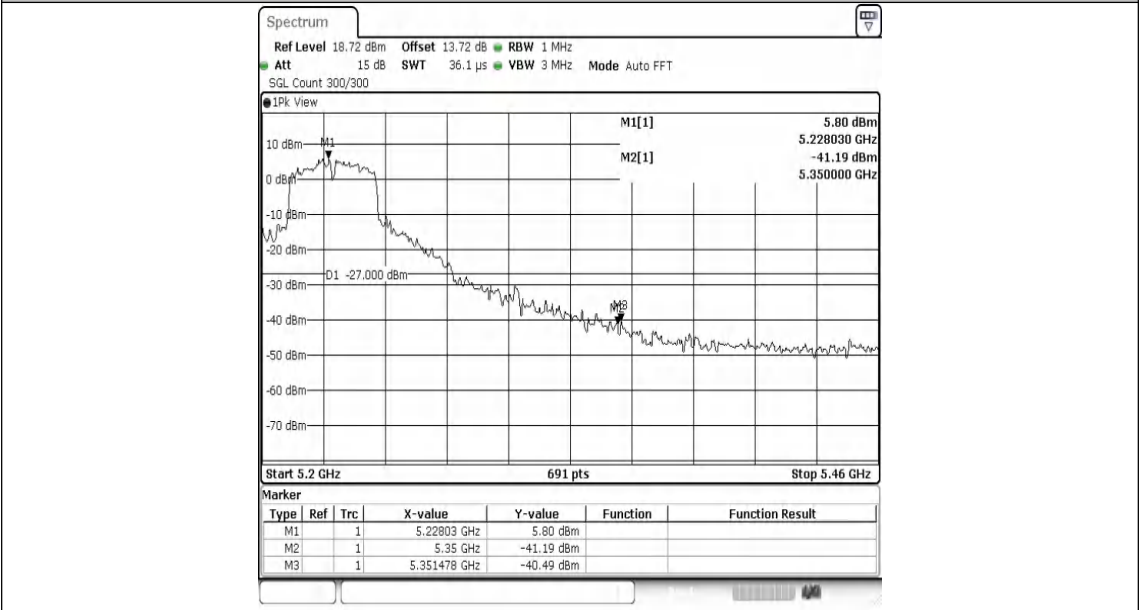

11AC40SISO-Ant1-5230-PASS



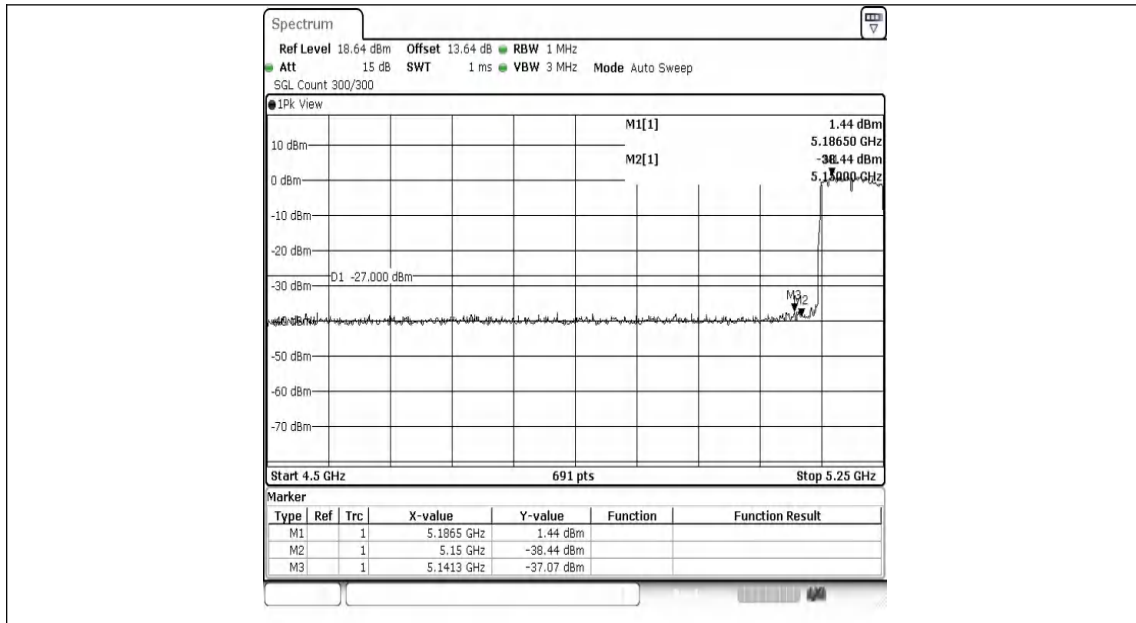


11AC80SISO-Ant1-5210-PASS




11AC80SISO-Ant1-5210-PASS




Test Graphs B4

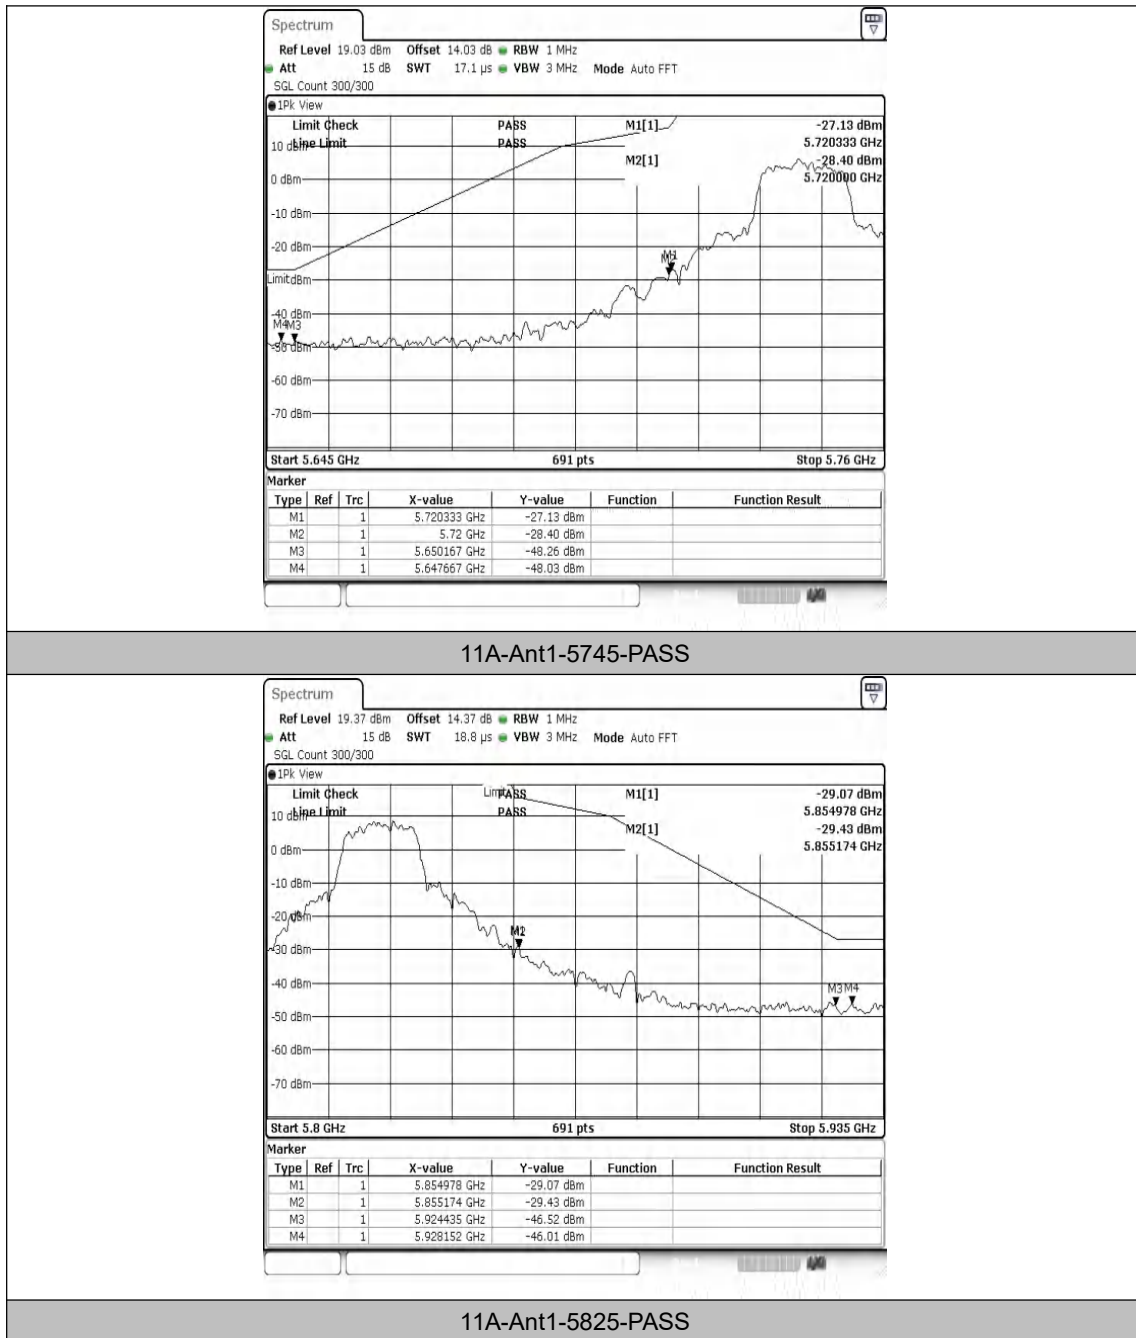

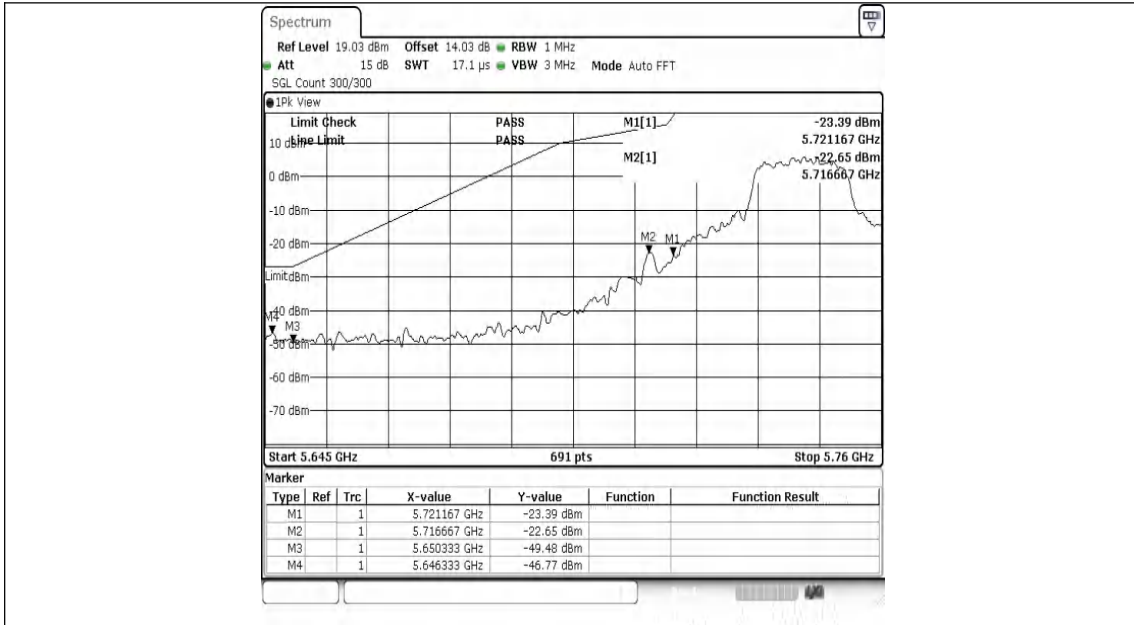


11N20SISO-Ant1-5745-PASS

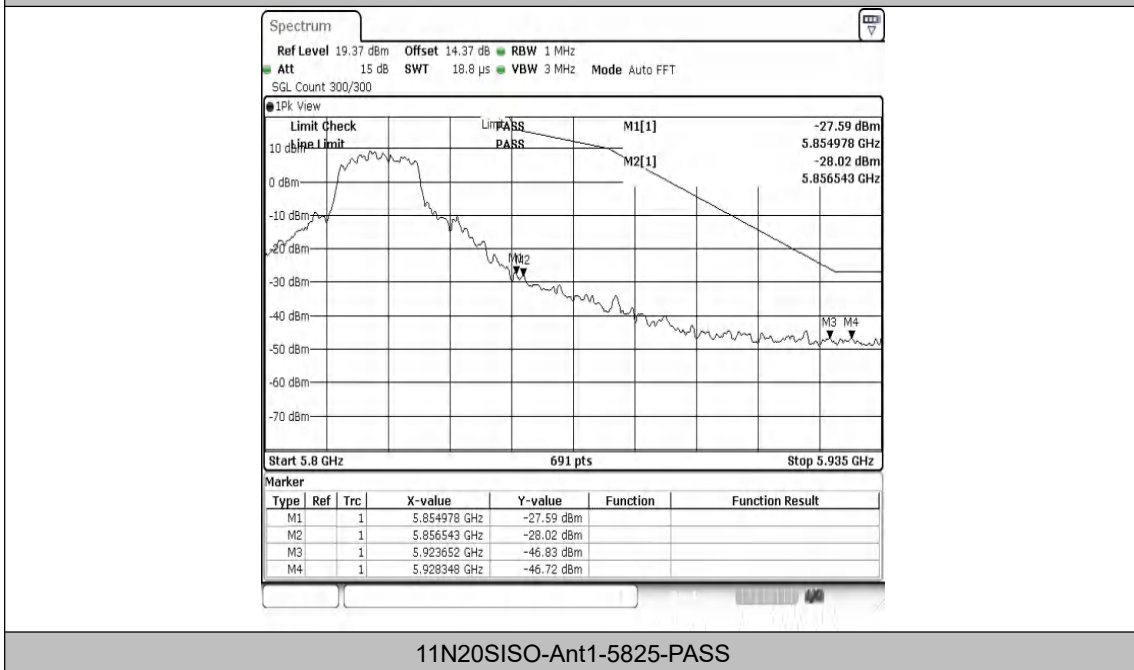

11N20SISO-Ant1-5825-PASS



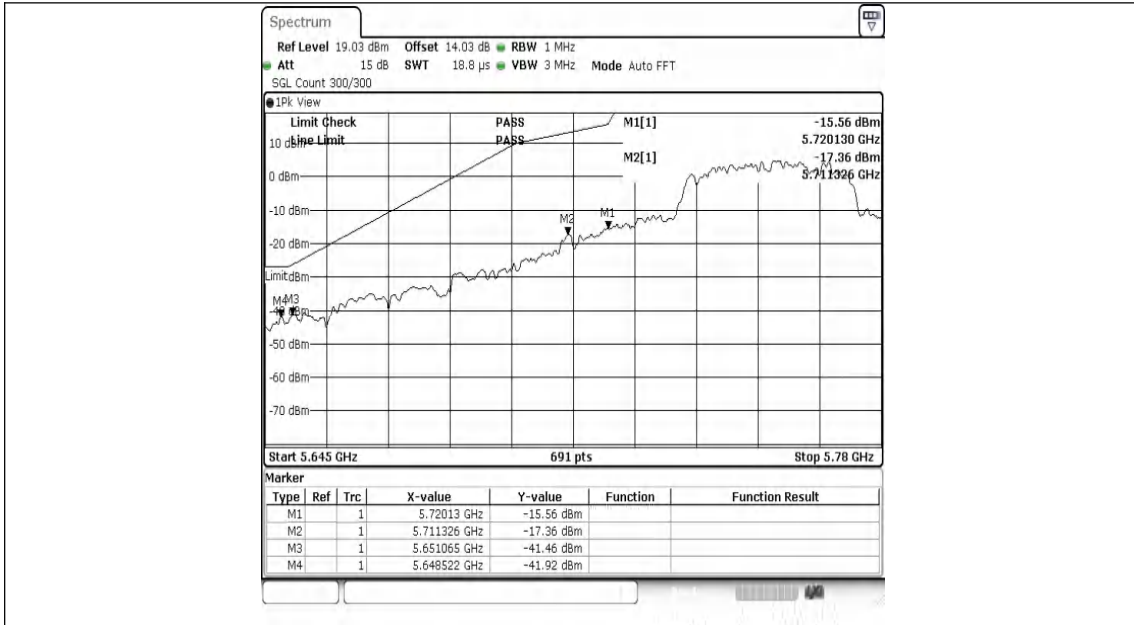



11N40SISO-Ant1-5755-PASS




11N40SISO-Ant1-5795-PASS



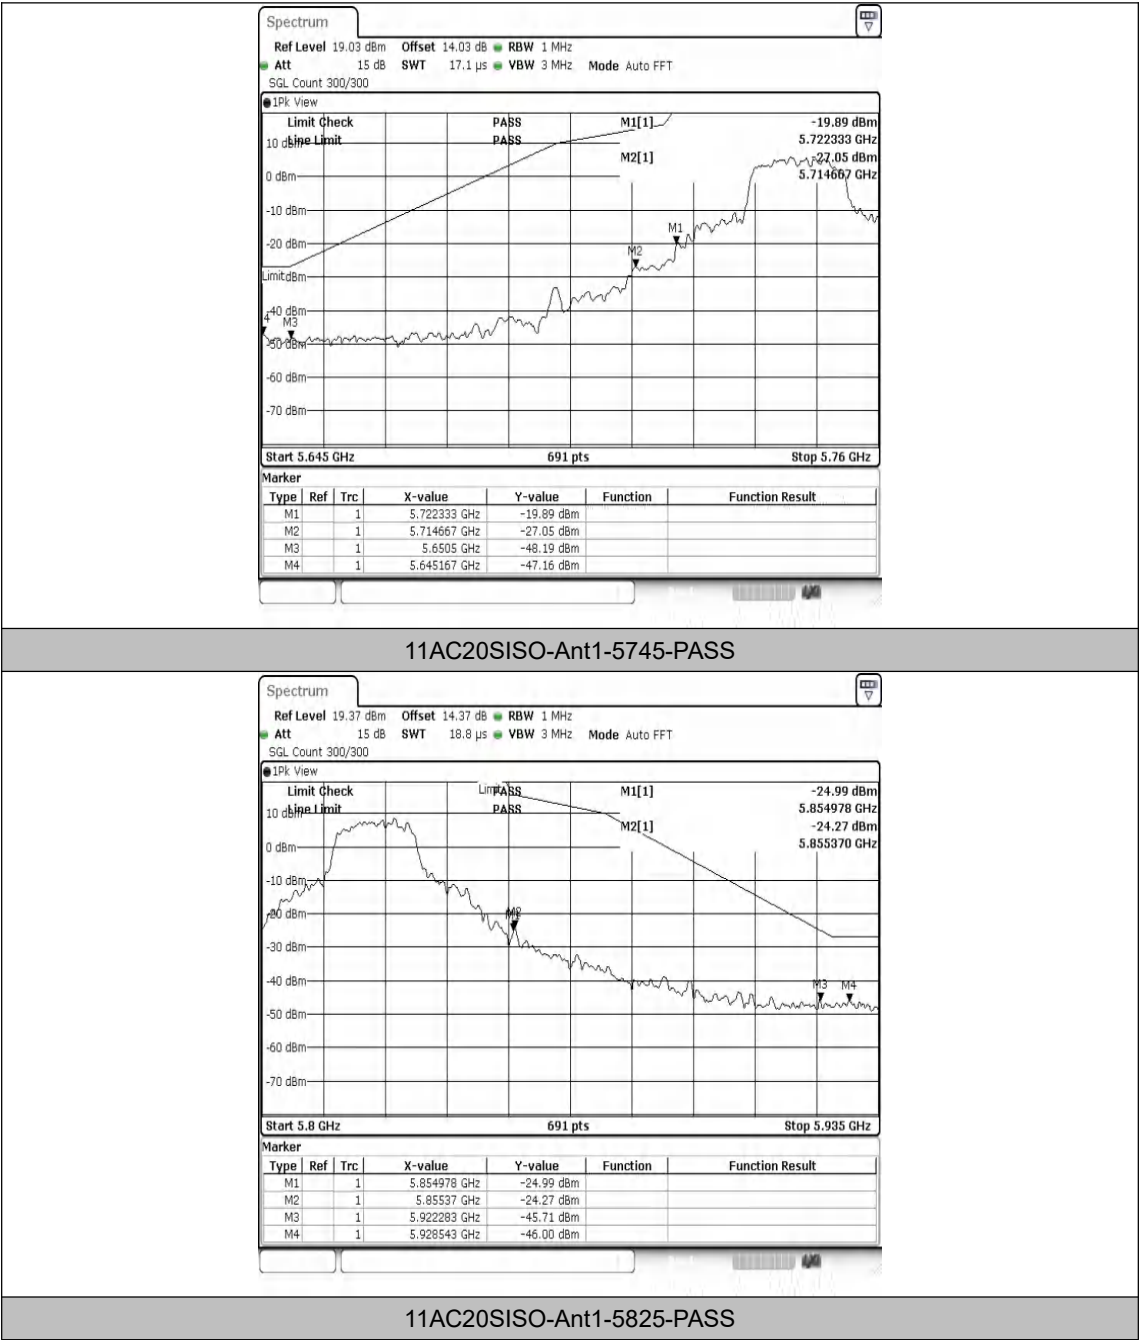

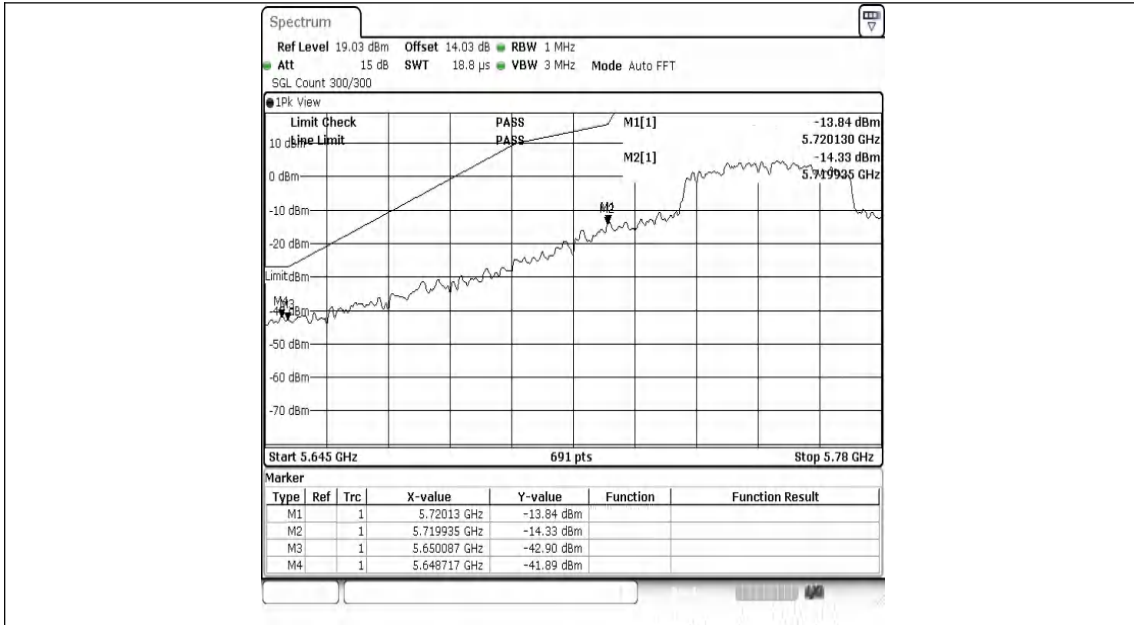


11AC40SISO-Ant1-5755-PASS

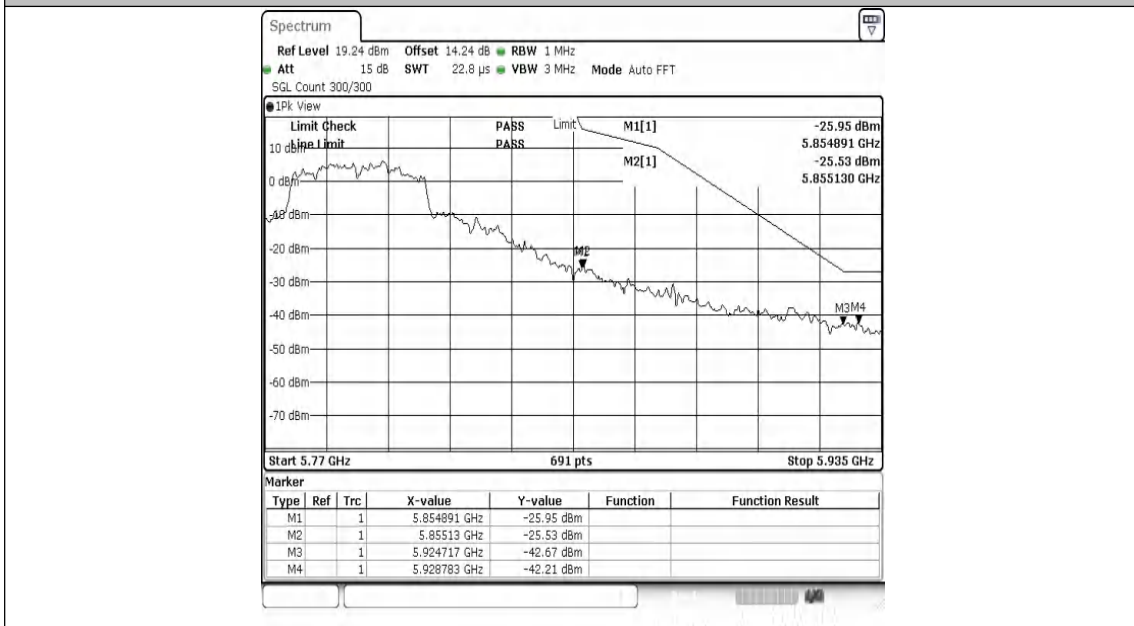

11AC40SISO-Ant1-5795-PASS



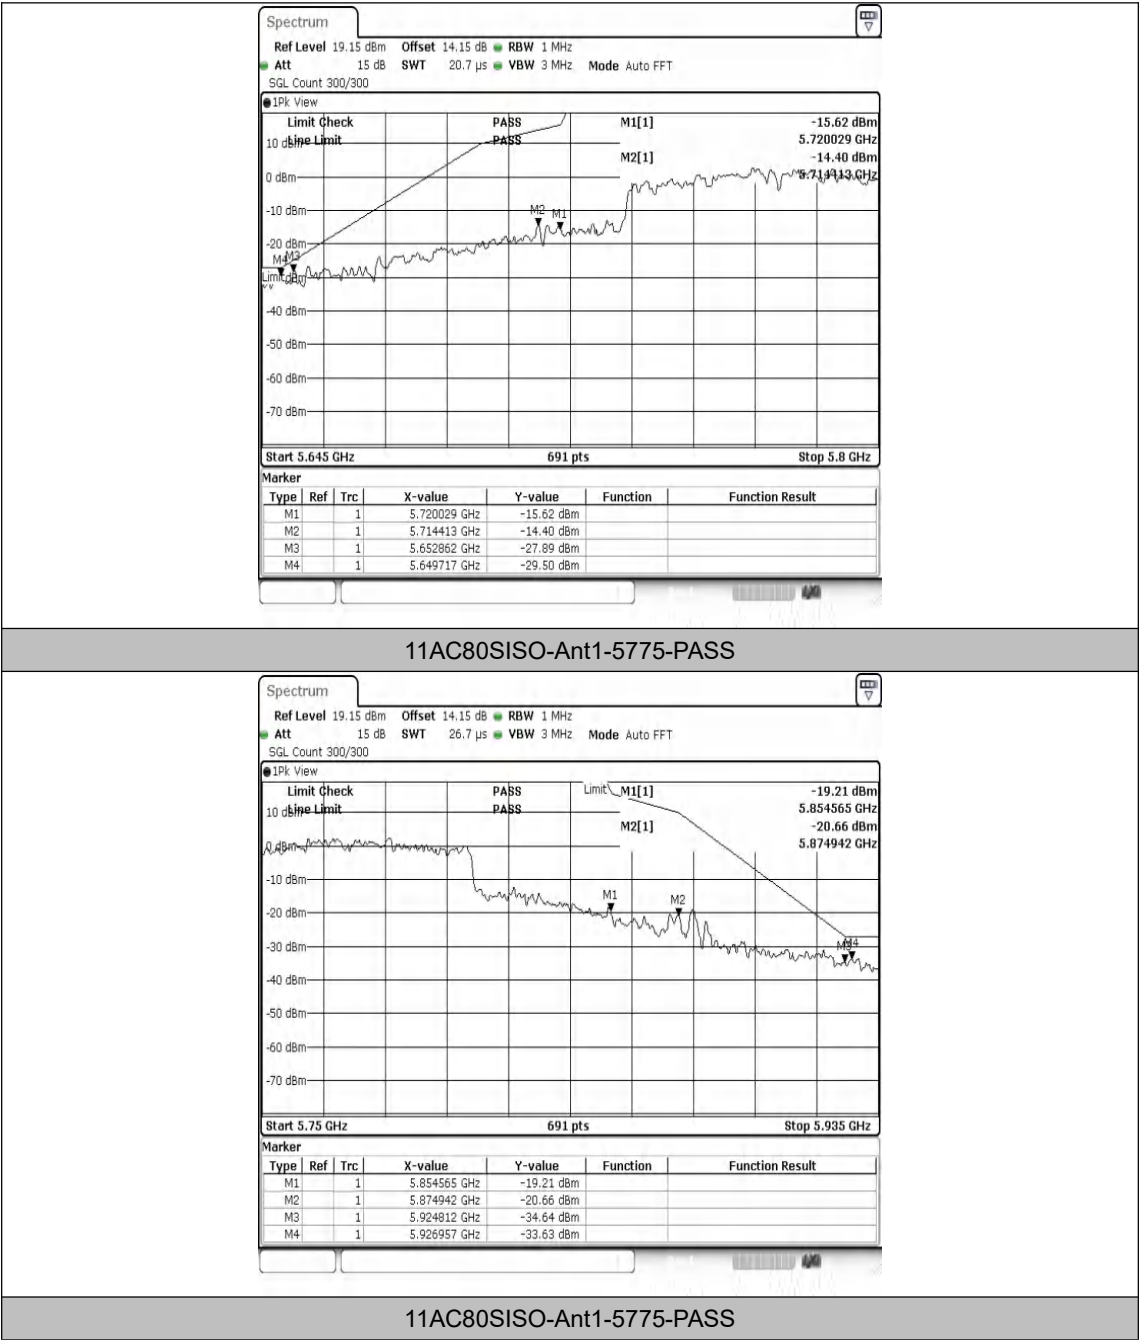

---End---

