


Band5	10MHz	16QAM	20525	50RB#0	3000~10000	-43.59	-13.0	PASS
Band5	10MHz	QPSK	20600	1RB#0	0.009~0.15	-48.21	-33.0	PASS
Band5	10MHz	QPSK	20600	1RB#0	0.15~30	-42.82	-23.0	PASS
Band5	10MHz	QPSK	20600	1RB#0	30~1000	-56.61	-13.0	PASS
Band5	10MHz	QPSK	20600	1RB#0	1000~3000	-47.11	-13.0	PASS
Band5	10MHz	QPSK	20600	1RB#0	3000~10000	-43.94	-13.0	PASS
Band5	10MHz	QPSK	20600	1RB#49	0.009~0.15	-46.33	-33.0	PASS
Band5	10MHz	QPSK	20600	1RB#49	0.15~30	-38.21	-23.0	PASS
Band5	10MHz	QPSK	20600	1RB#49	30~1000	-53.41	-13.0	PASS
Band5	10MHz	QPSK	20600	1RB#49	1000~3000	-47.11	-13.0	PASS
Band5	10MHz	QPSK	20600	1RB#49	3000~10000	-43.97	-13.0	PASS
Band5	10MHz	QPSK	20600	50RB#0	0.009~0.15	-48.64	-33.0	PASS
Band5	10MHz	QPSK	20600	50RB#0	0.15~30	-40.47	-23.0	PASS
Band5	10MHz	QPSK	20600	50RB#0	30~1000	-41.09	-13.0	PASS
Band5	10MHz	QPSK	20600	50RB#0	1000~3000	-46.88	-13.0	PASS
Band5	10MHz	QPSK	20600	50RB#0	3000~10000	-43.71	-13.0	PASS
Band5	10MHz	16QAM	20600	1RB#0	0.009~0.15	-47.51	-33.0	PASS
Band5	10MHz	16QAM	20600	1RB#0	0.15~30	-36.46	-23.0	PASS
Band5	10MHz	16QAM	20600	1RB#0	30~1000	-56.75	-13.0	PASS
Band5	10MHz	16QAM	20600	1RB#0	1000~3000	-46.96	-13.0	PASS
Band5	10MHz	16QAM	20600	1RB#0	3000~10000	-44.13	-13.0	PASS
Band5	10MHz	16QAM	20600	1RB#49	0.009~0.15	-47.28	-33.0	PASS
Band5	10MHz	16QAM	20600	1RB#49	0.15~30	-39.10	-23.0	PASS
Band5	10MHz	16QAM	20600	1RB#49	30~1000	-53.74	-13.0	PASS
Band5	10MHz	16QAM	20600	1RB#49	1000~3000	-47.03	-13.0	PASS
Band5	10MHz	16QAM	20600	1RB#49	3000~10000	-43.98	-13.0	PASS
Band5	10MHz	16QAM	20600	50RB#0	0.009~0.15	-40.62	-33.0	PASS
Band5	10MHz	16QAM	20600	50RB#0	0.15~30	-36.91	-23.0	PASS
Band5	10MHz	16QAM	20600	50RB#0	30~1000	-39.75	-13.0	PASS
Band5	10MHz	16QAM	20600	50RB#0	1000~3000	-47.07	-13.0	PASS
Band5	10MHz	16QAM	20600	50RB#0	3000~10000	-43.70	-13.0	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

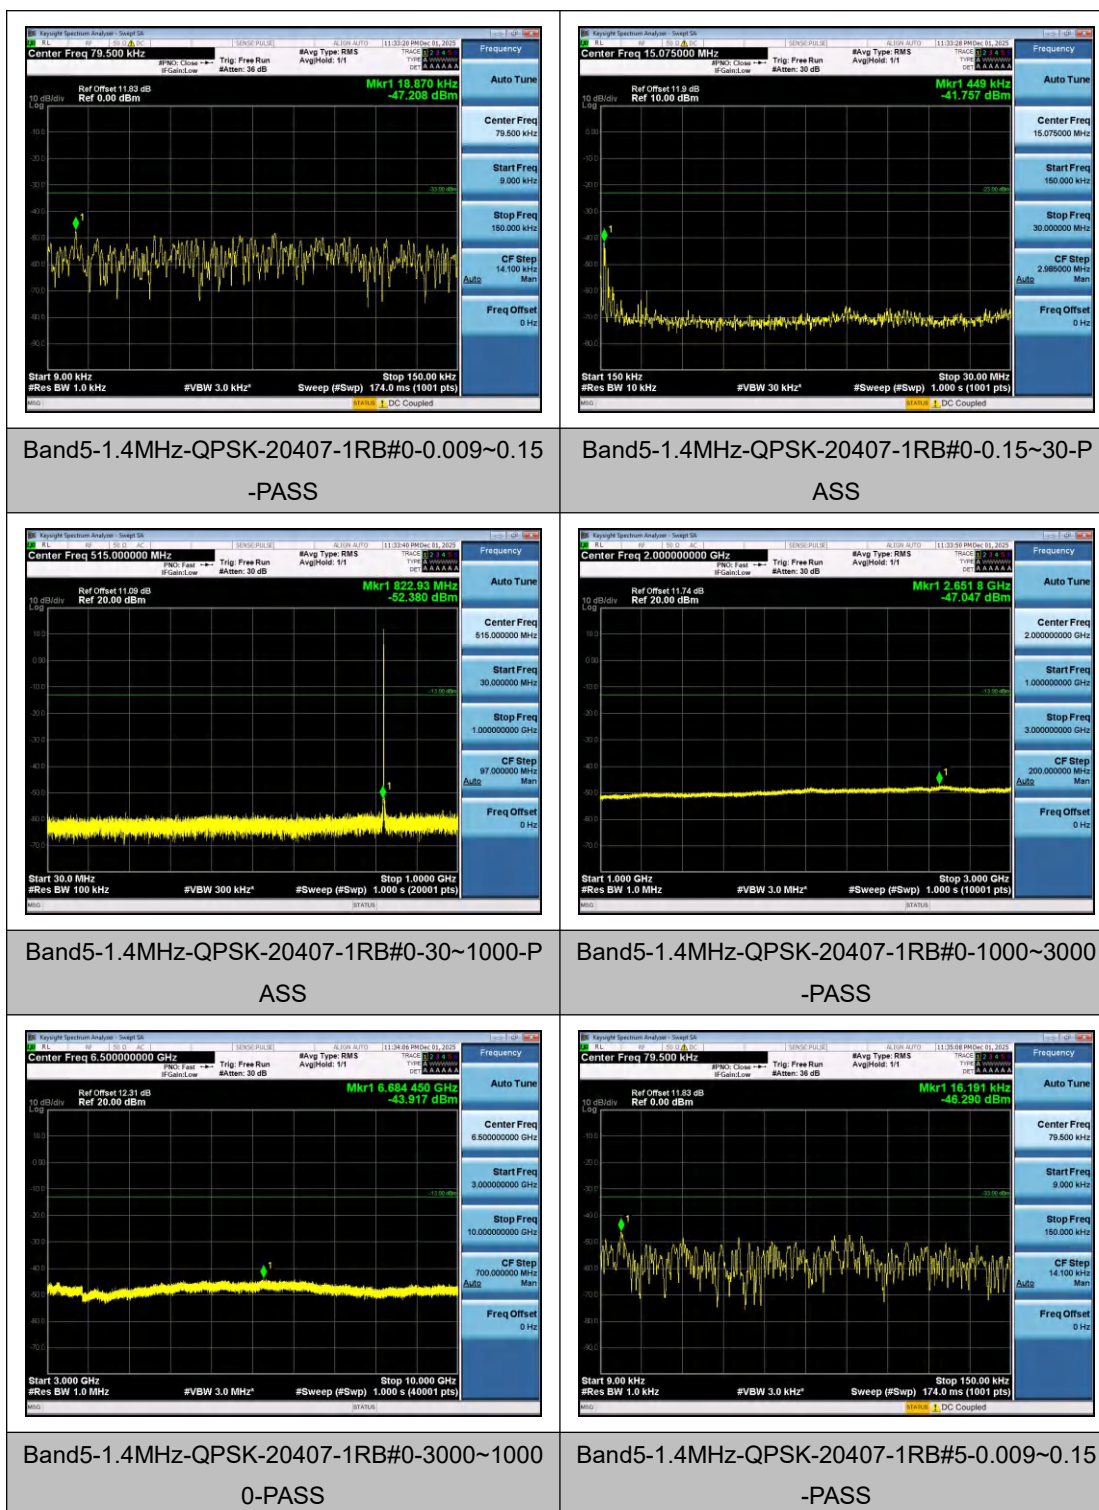


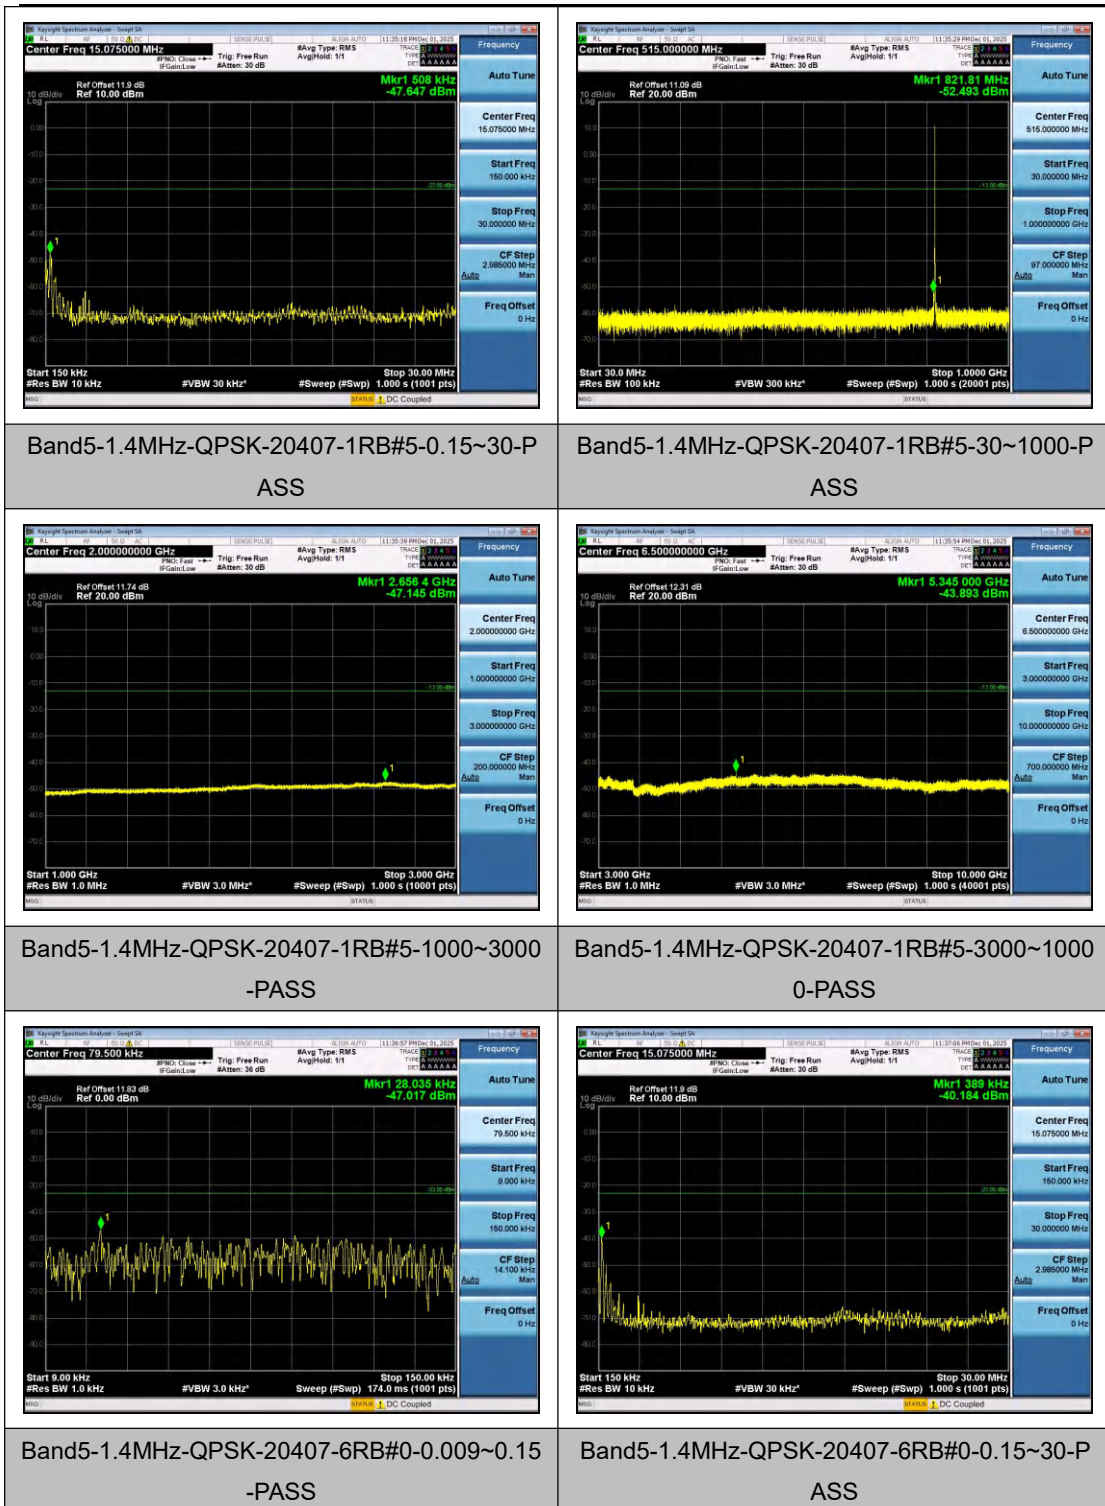


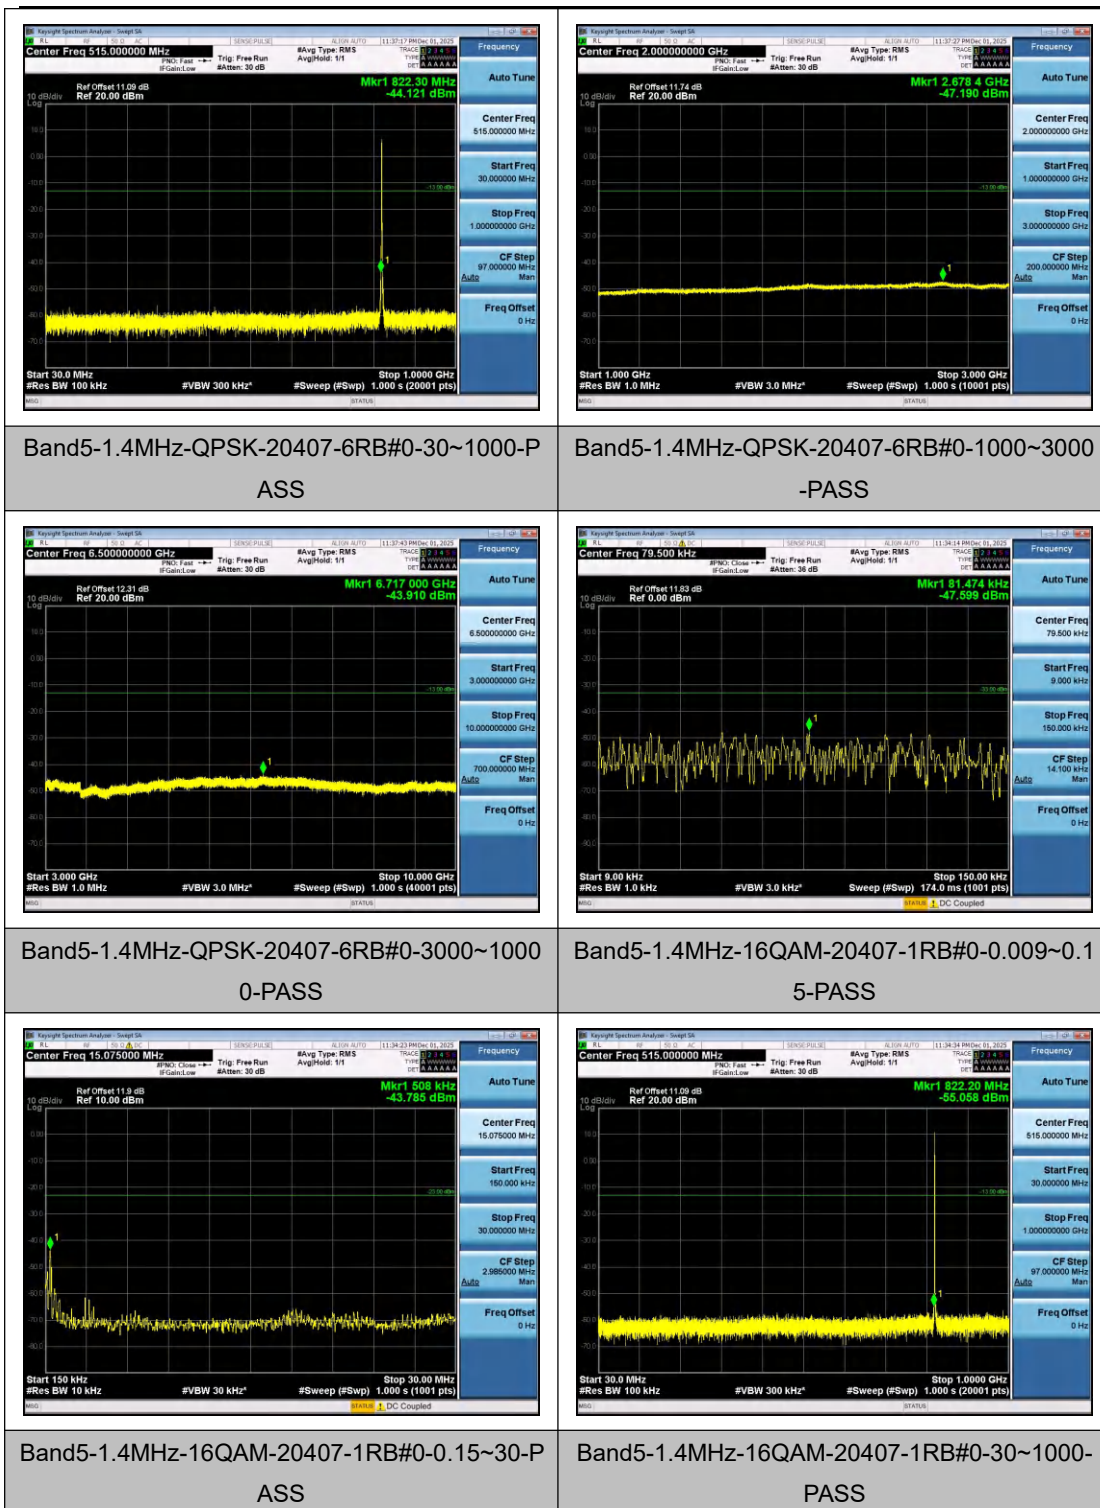


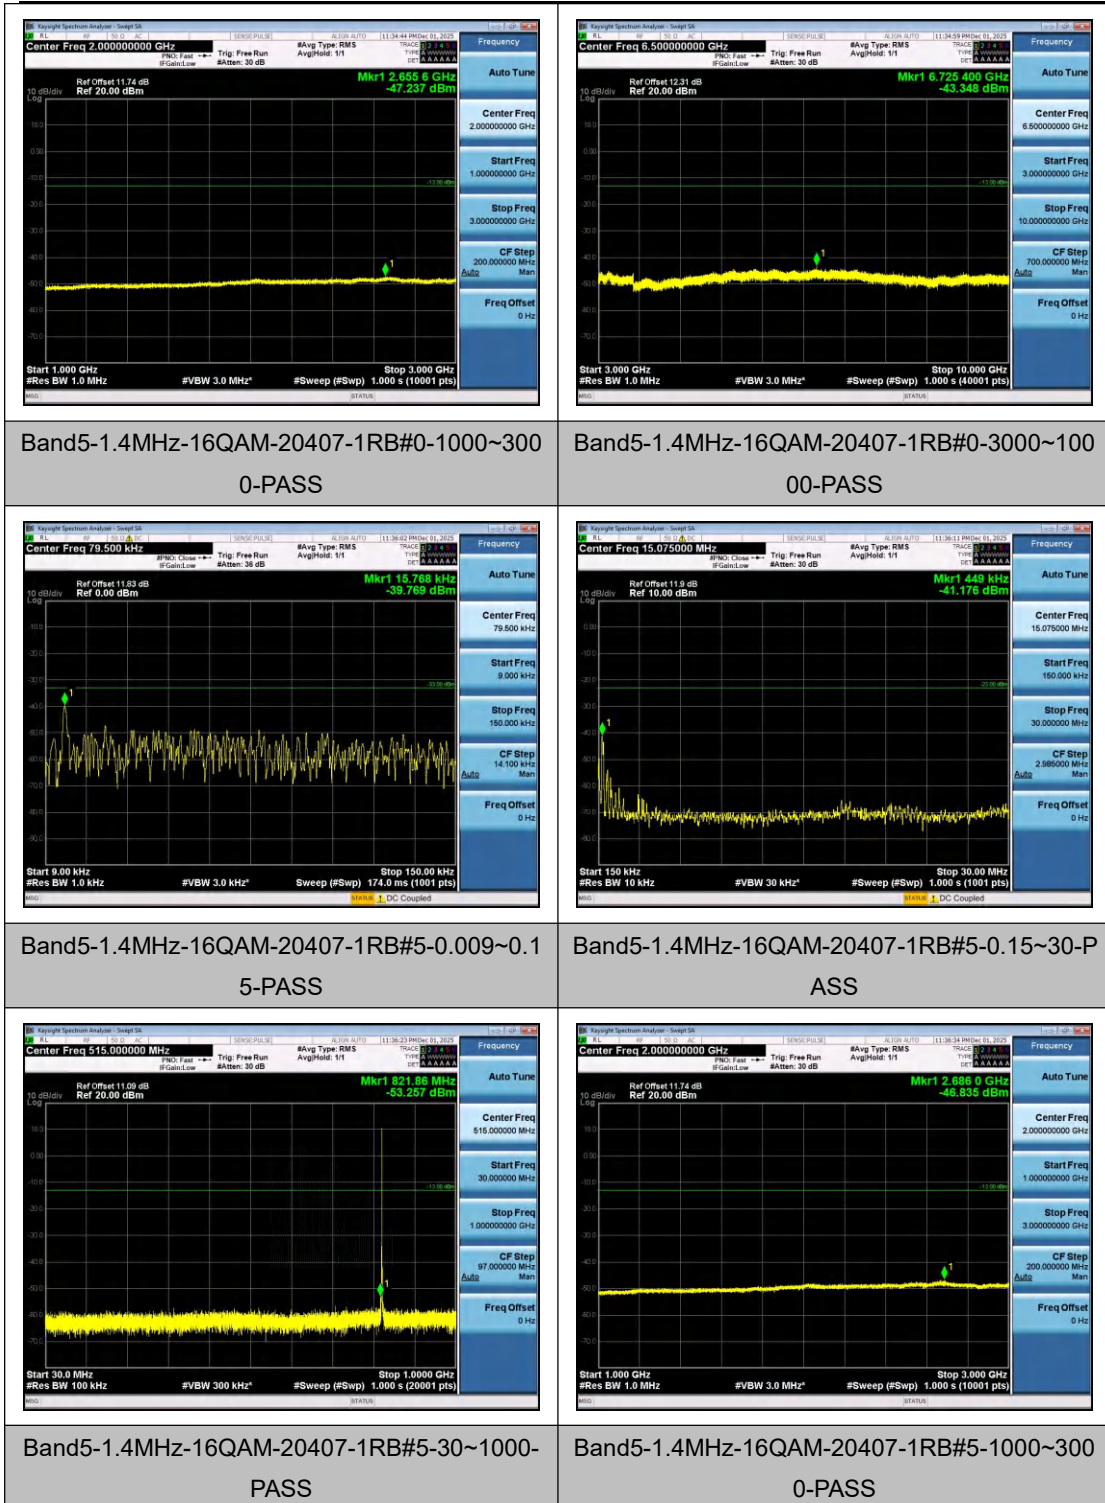


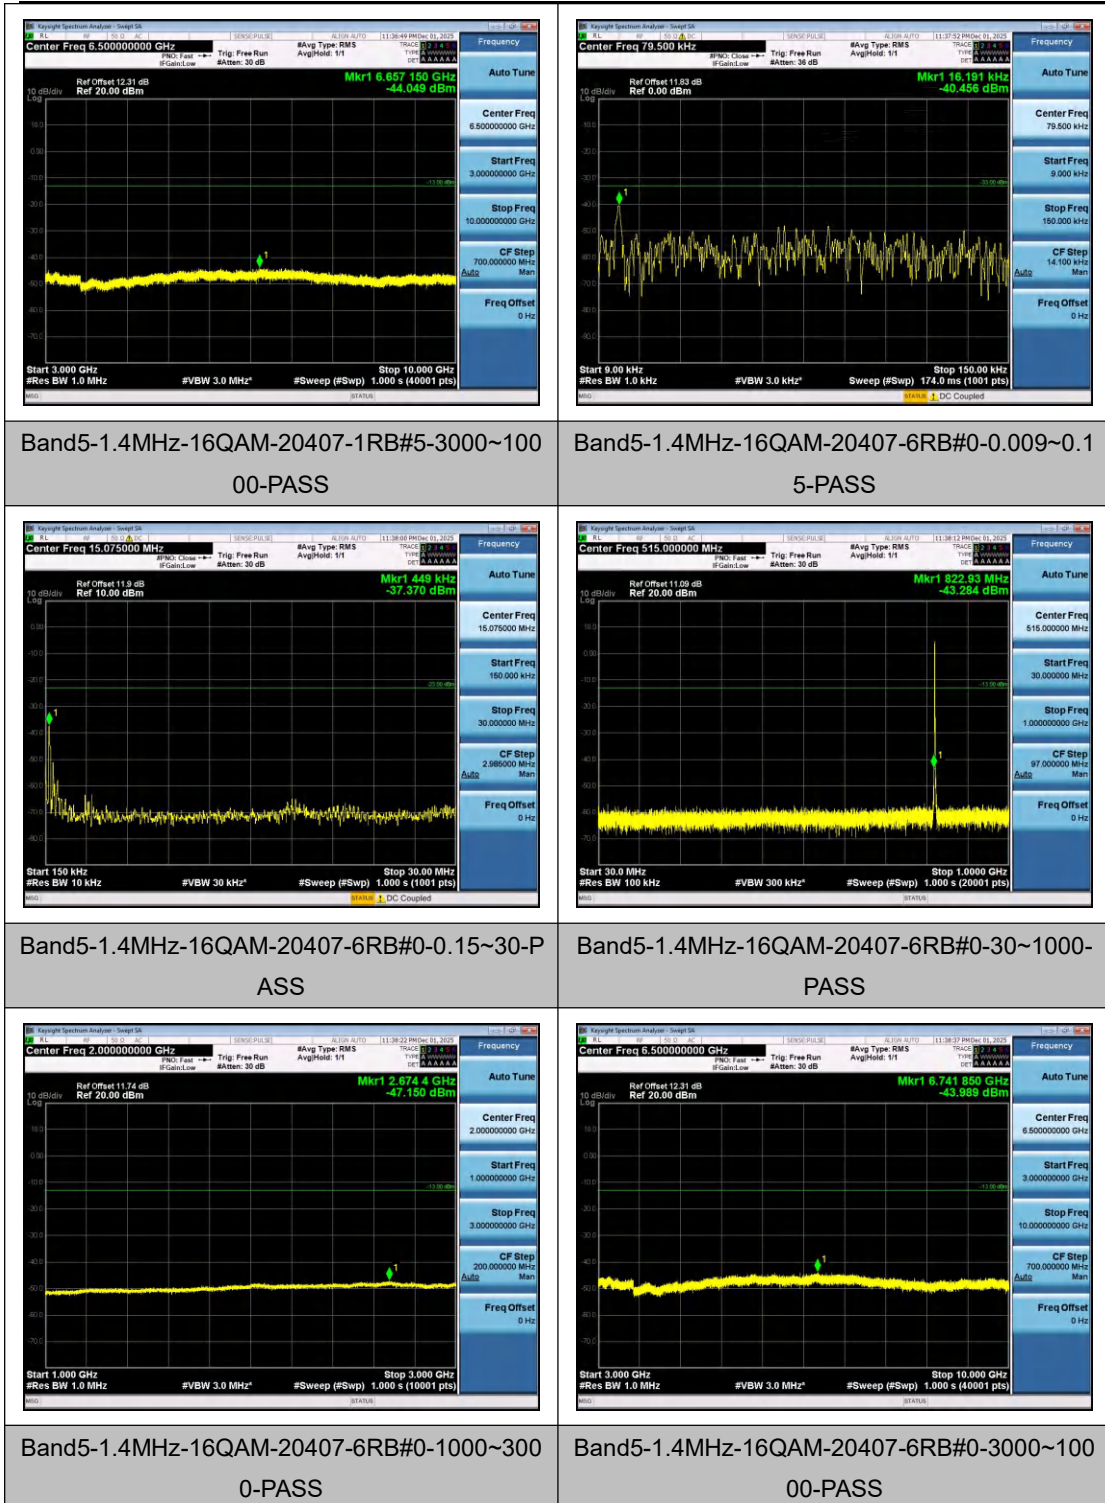


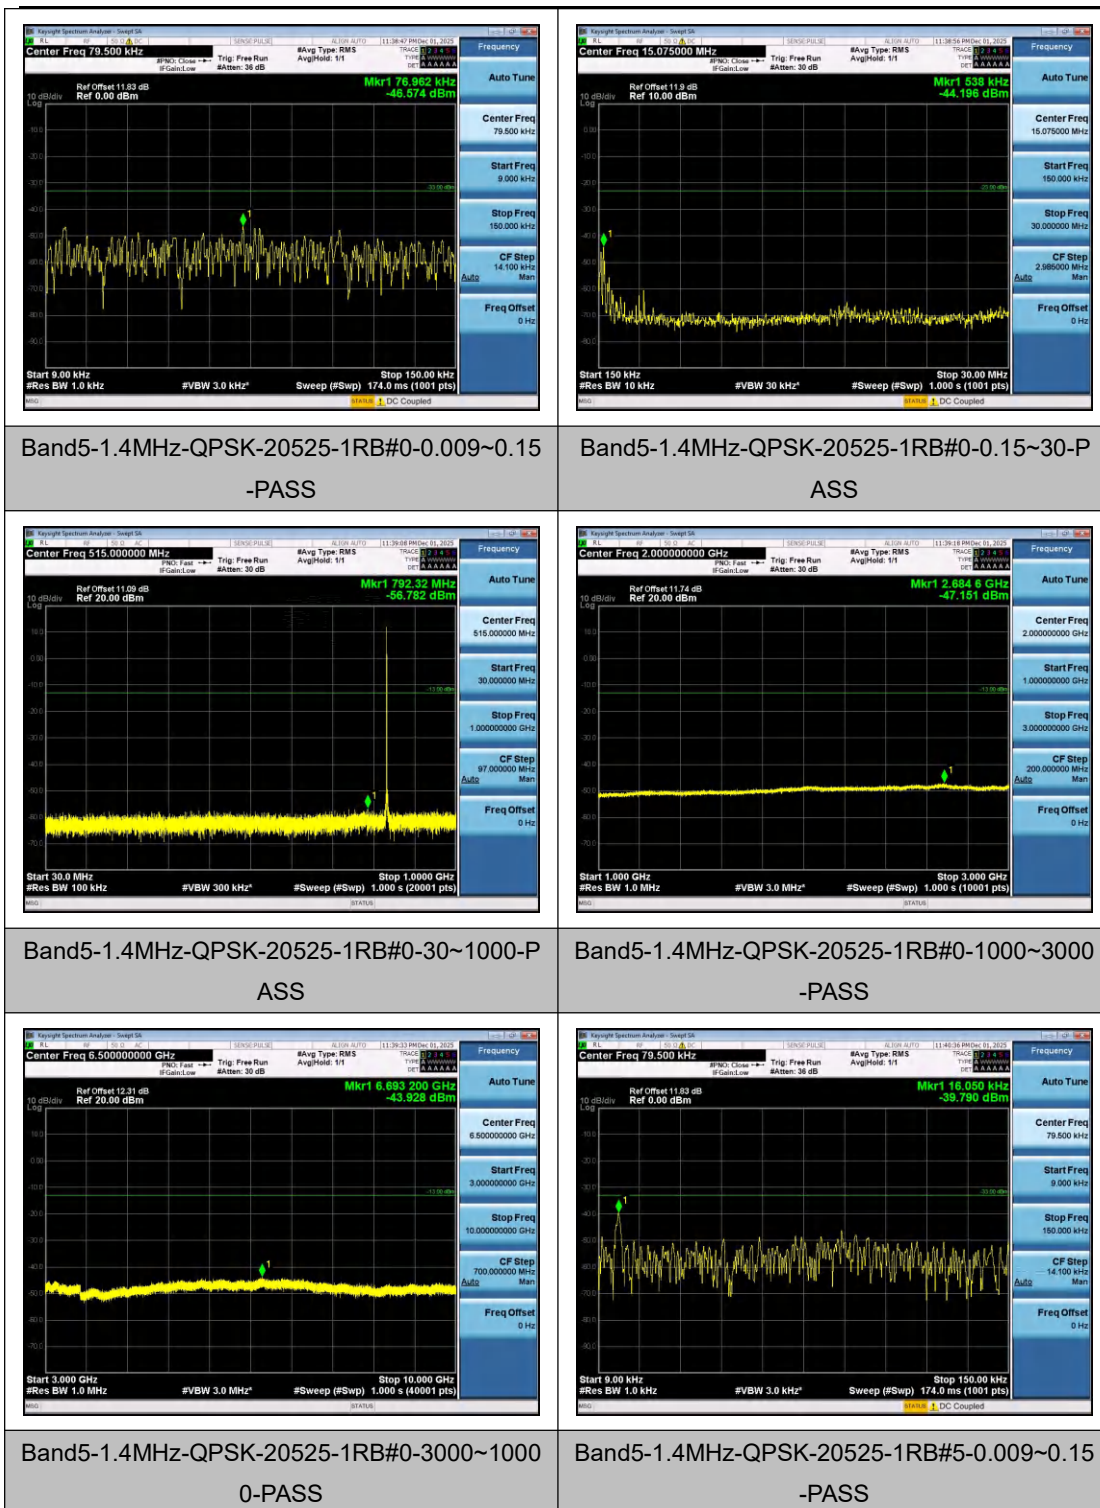


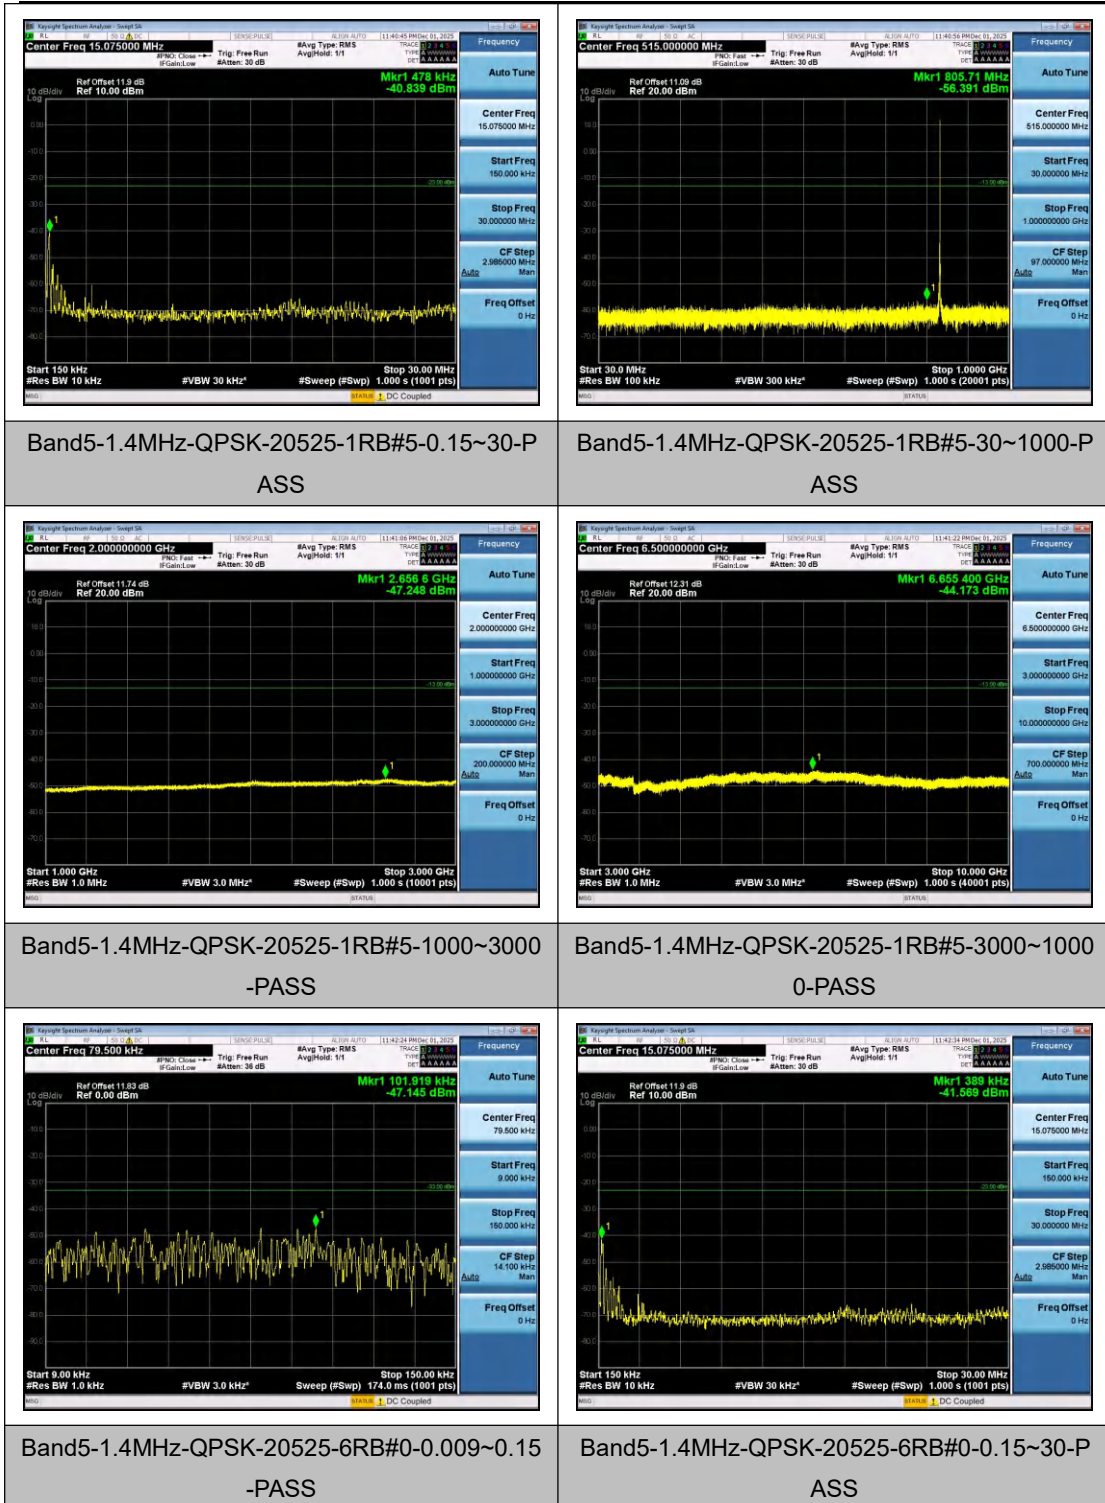


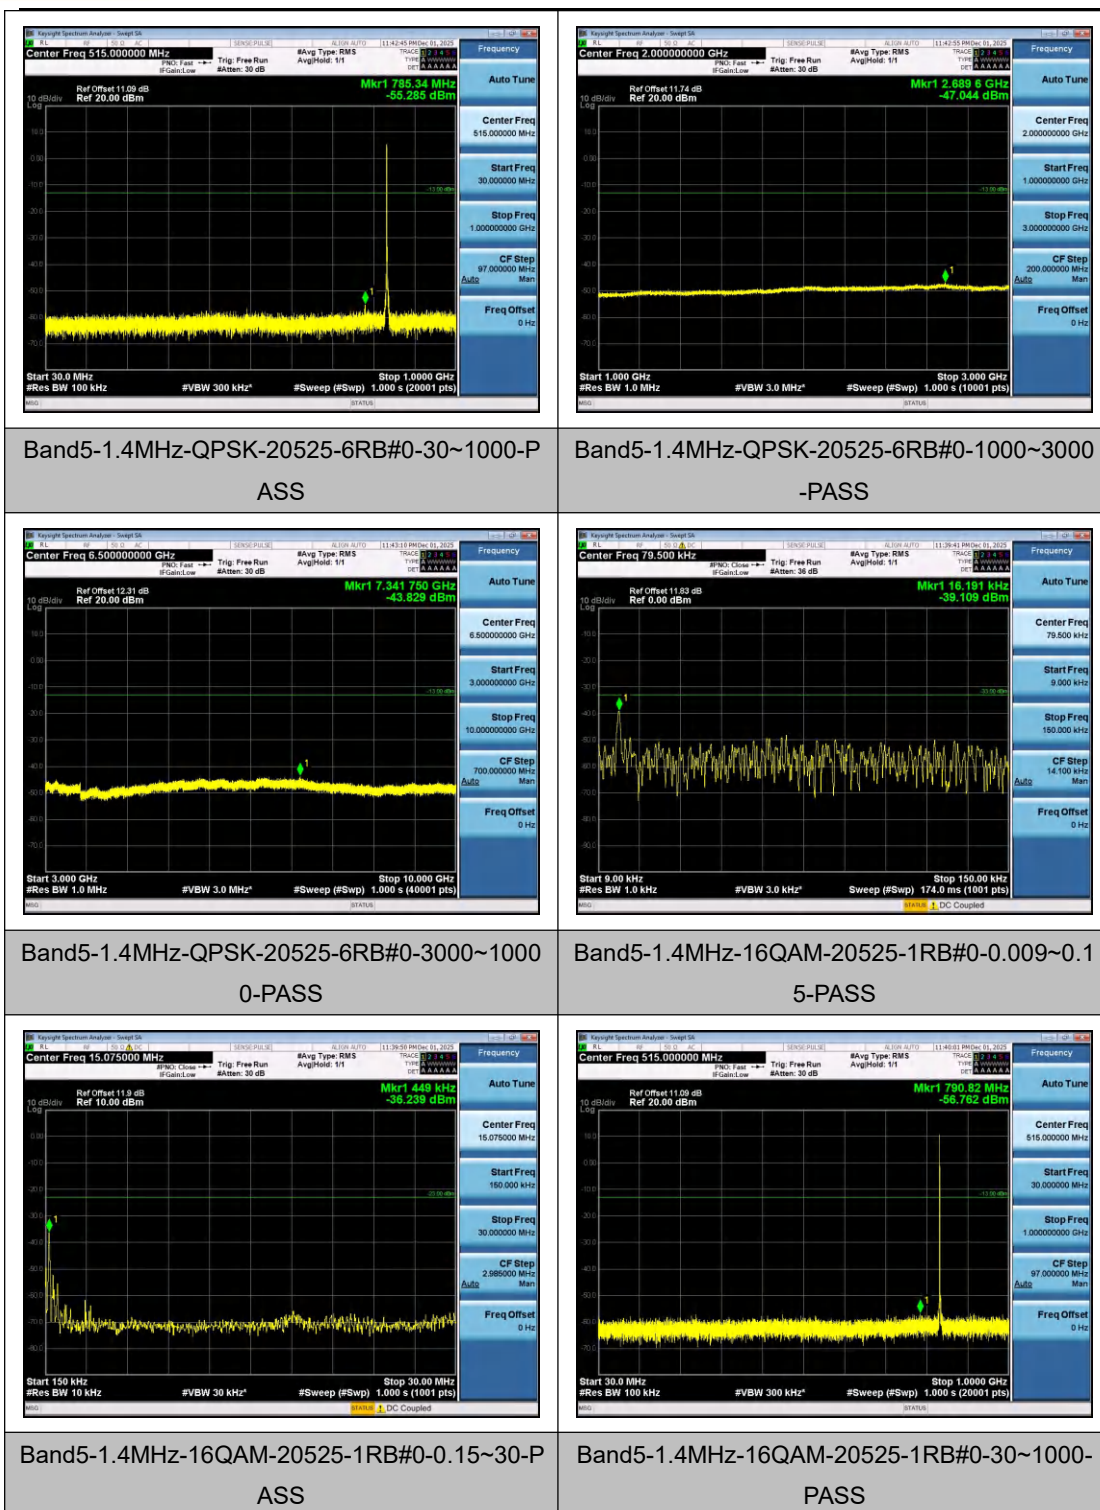


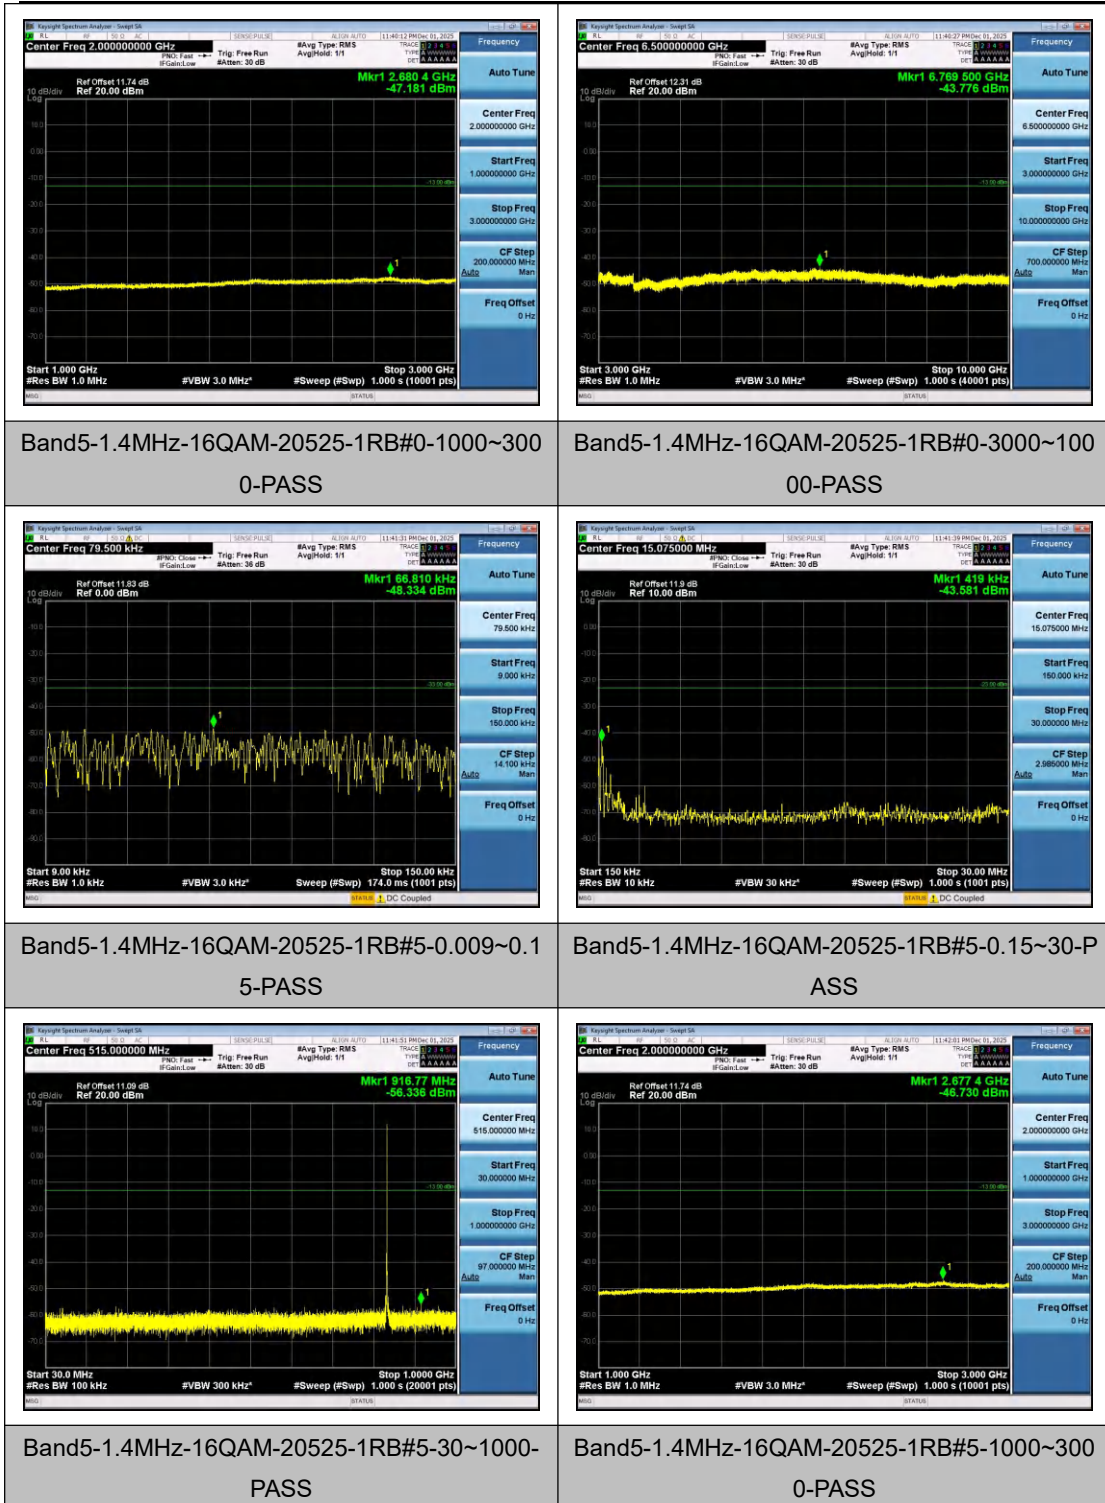


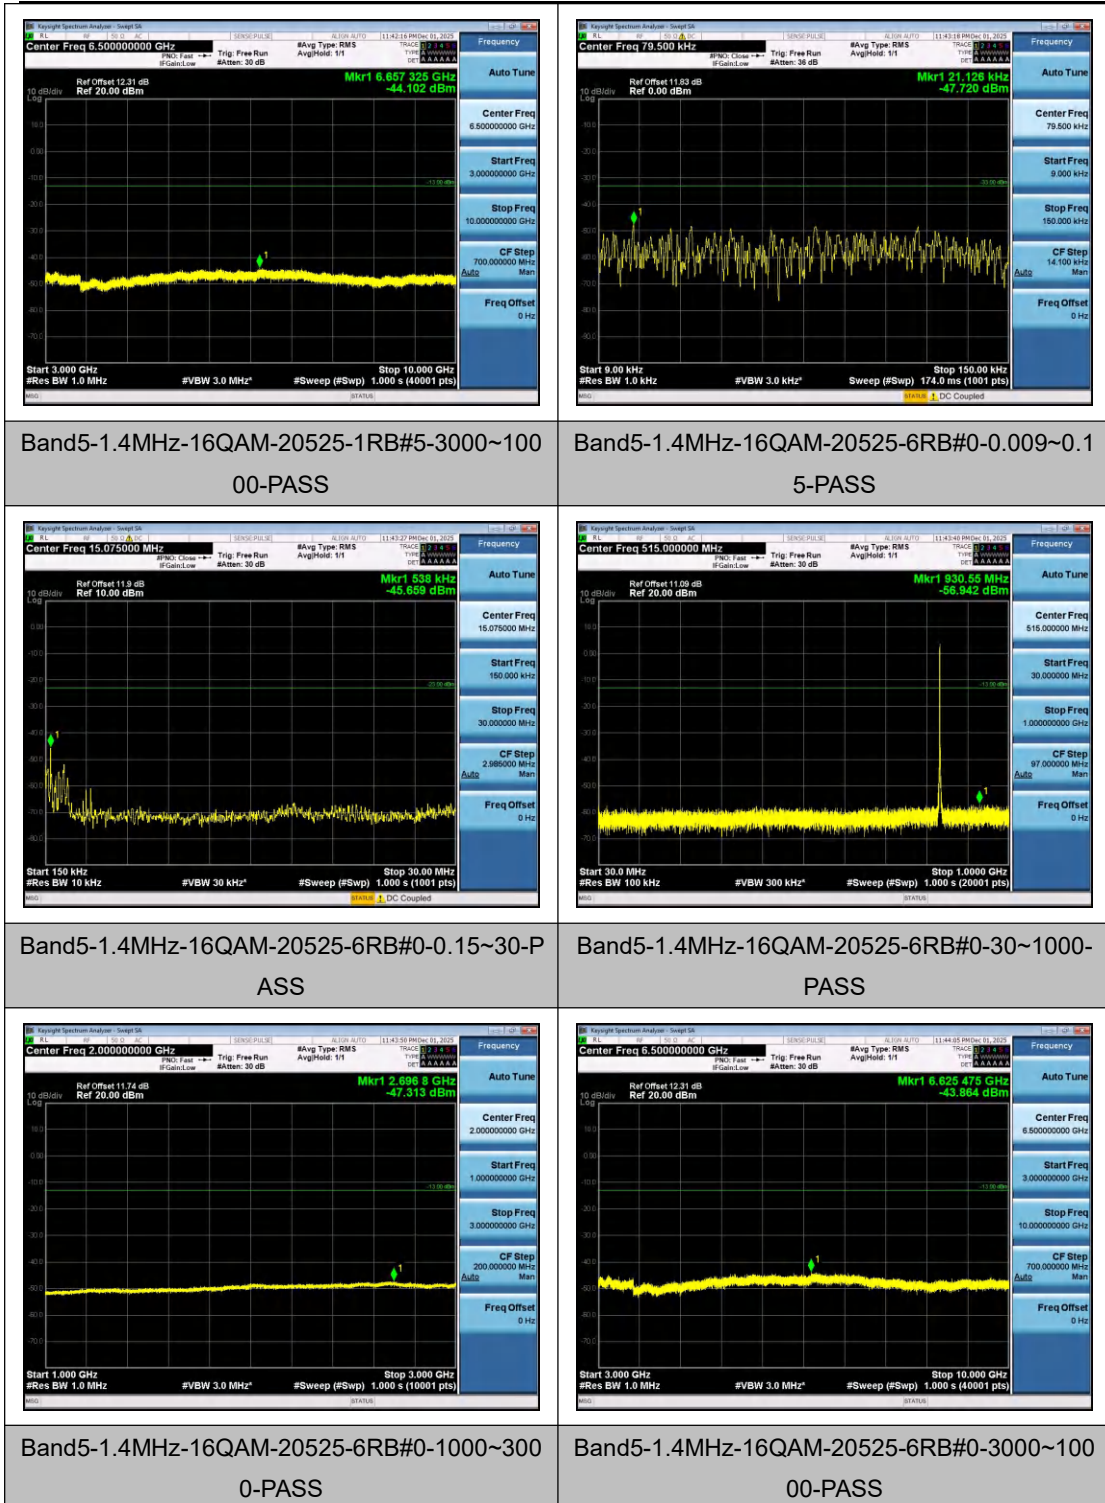

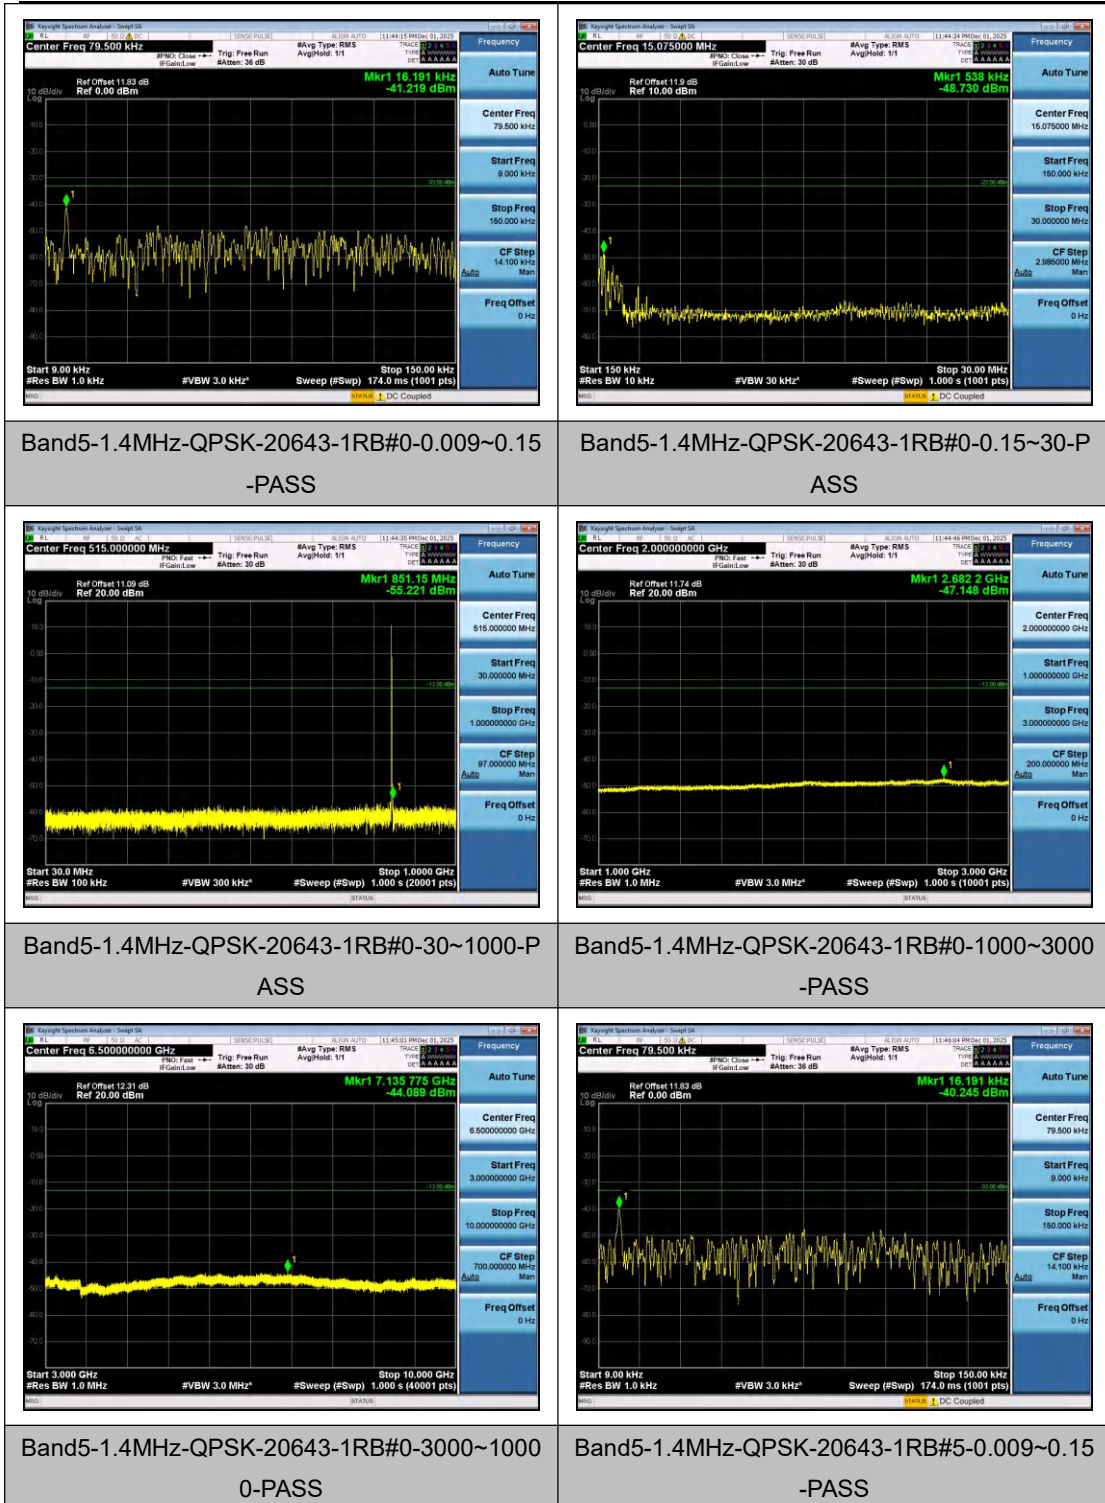

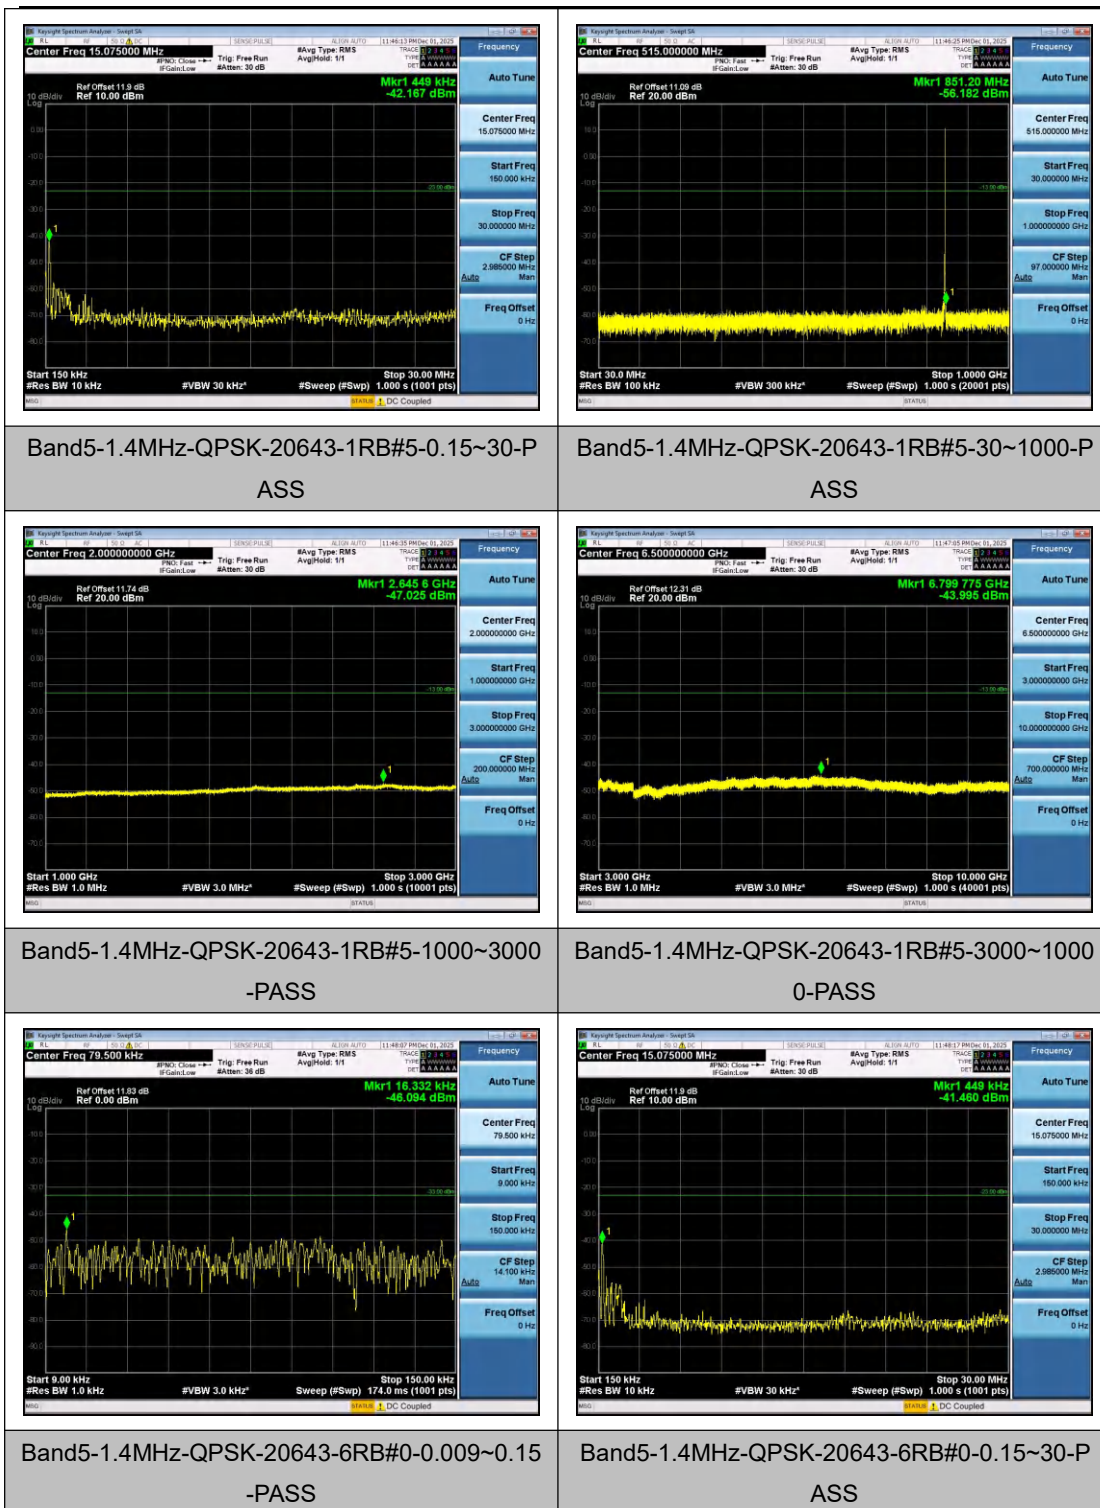

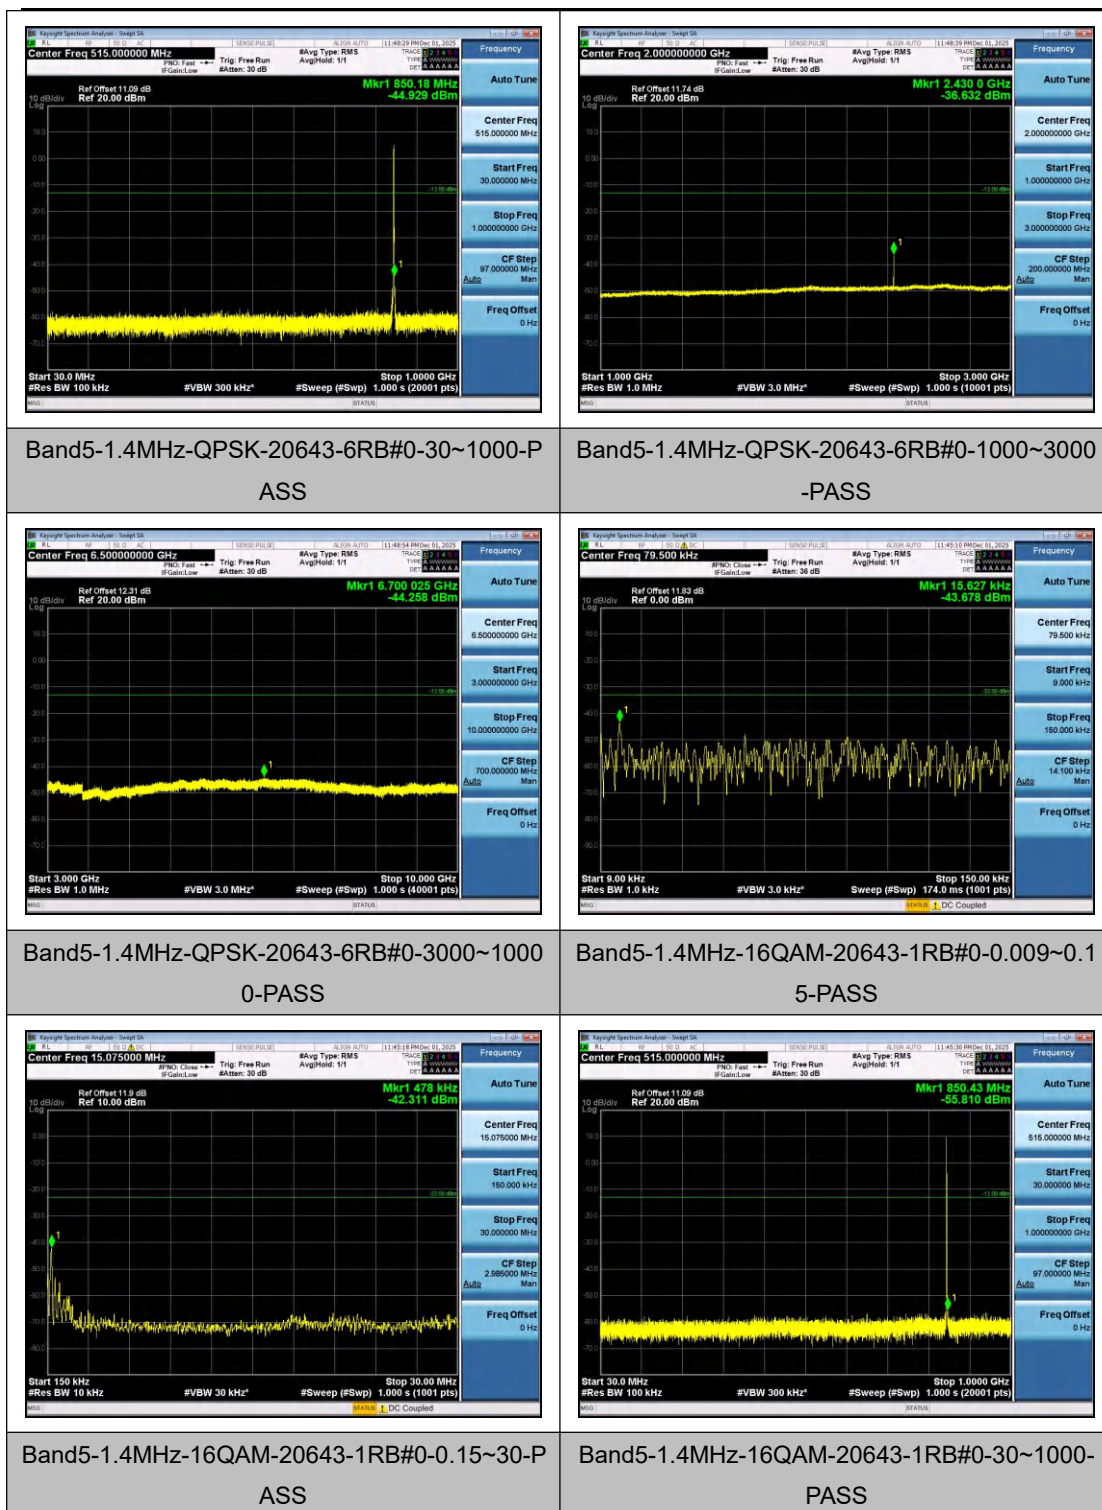

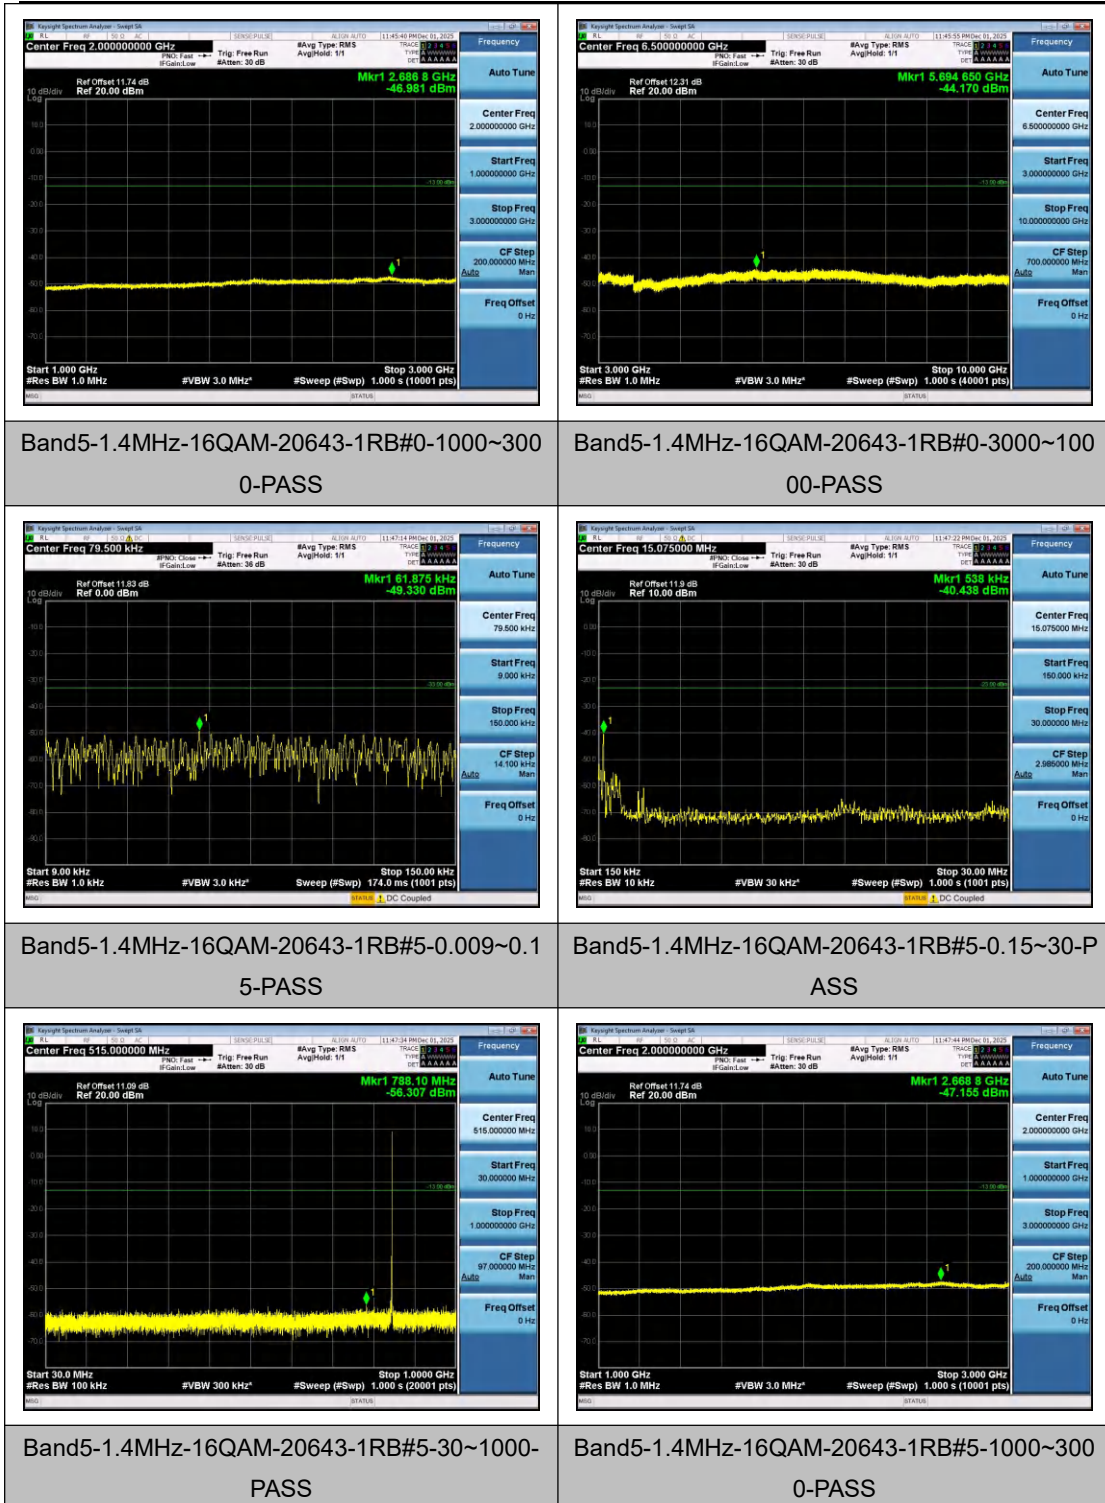

Band5-1.4MHz-16QAM-20643-1RB#5-3000~100 00-PASS	Band5-1.4MHz-16QAM-20643-6RB#0-0.009~0.1 5-PASS
Band5-1.4MHz-16QAM-20643-6RB#0-0.15~30-P ASS	Band5-1.4MHz-16QAM-20643-6RB#0-30~1000- PASS
Band5-1.4MHz-16QAM-20643-6RB#0-1000~300 0-PASS	Band5-1.4MHz-16QAM-20643-6RB#0-3000~100 00-PASS

