



5MHz_Low_QPSK_1@0(30MHz~20.1GHz)

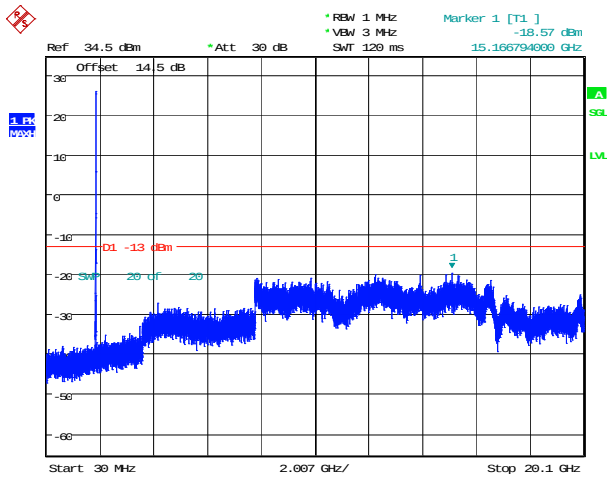


Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:12:40

5MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

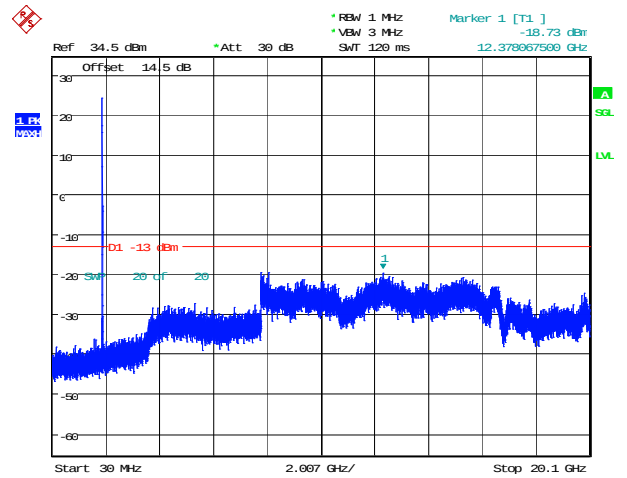


Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:13:24

5MHz_High_QPSK_1@0(30MHz~20.1GHz)

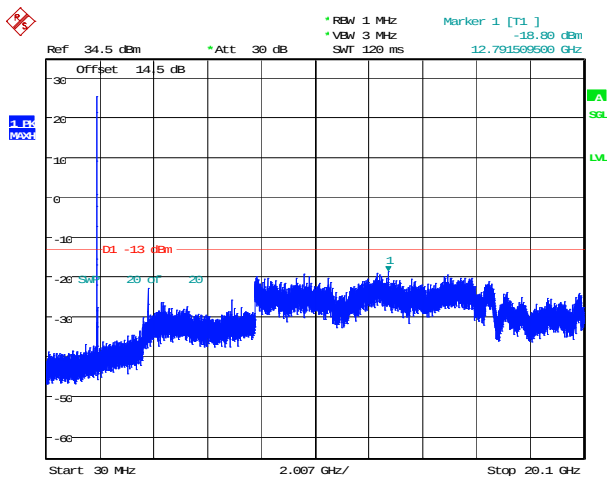


Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:14:06

10MHz_Low_QPSK_1@0(30MHz~20.1GHz)

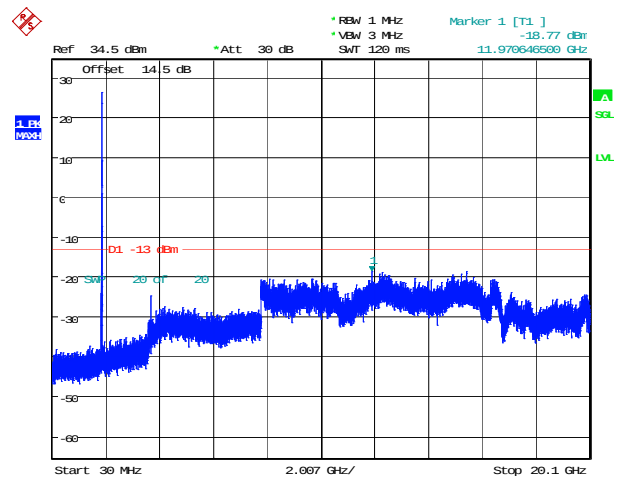


Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:14:53

10MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

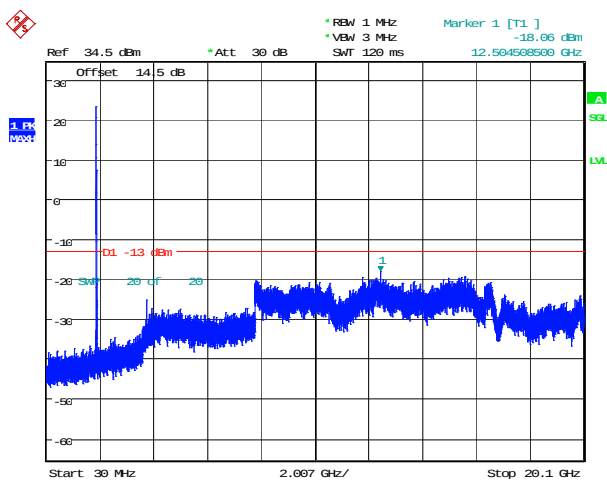


Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:15:43

10MHz_High_QPSK_1@0(30MHz~20.1GHz)

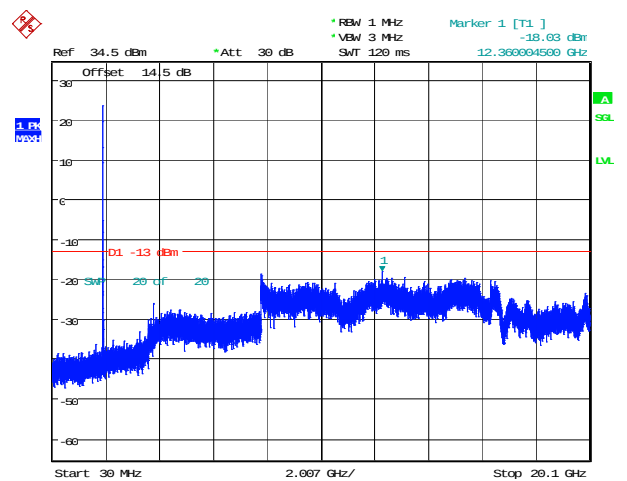


Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:16:27

15MHz_Low_QPSK_1@0(30MHz~20.1GHz)

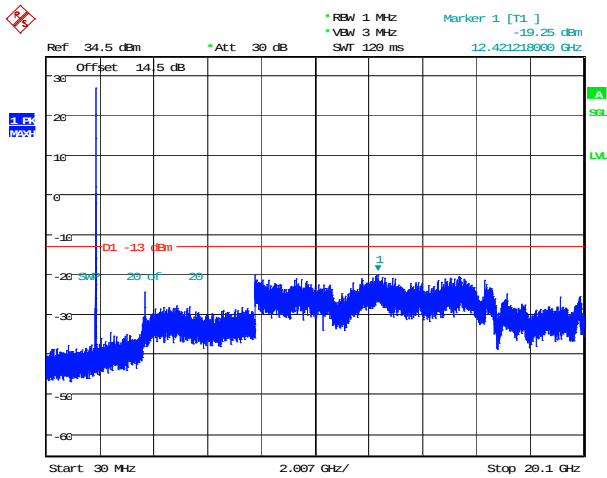


Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:17:14

15MHz_High_QPSK_1@0(30MHz~20.1GHz)

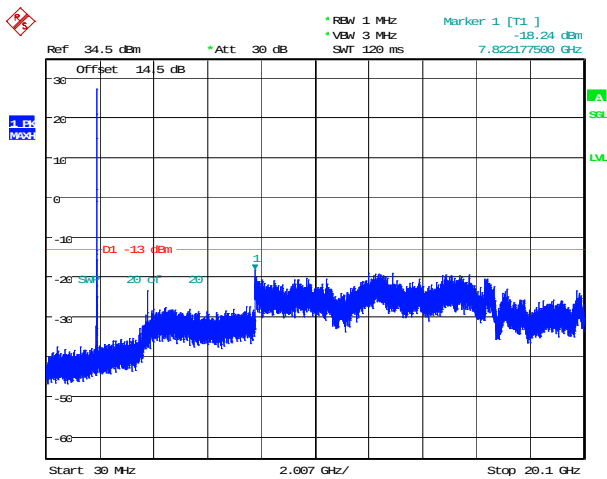


Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:18:42

20MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

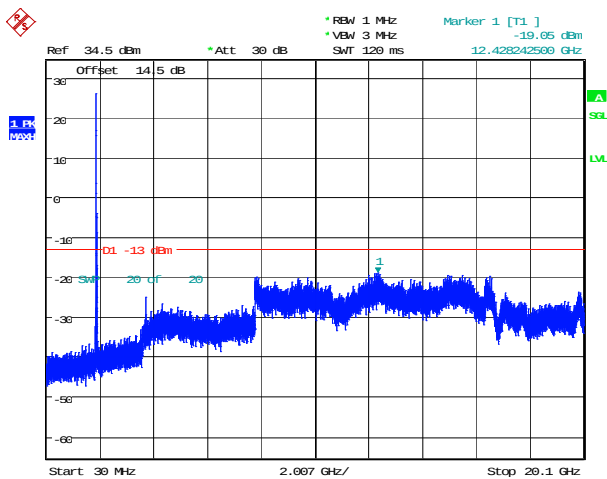


Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:20:14

15MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

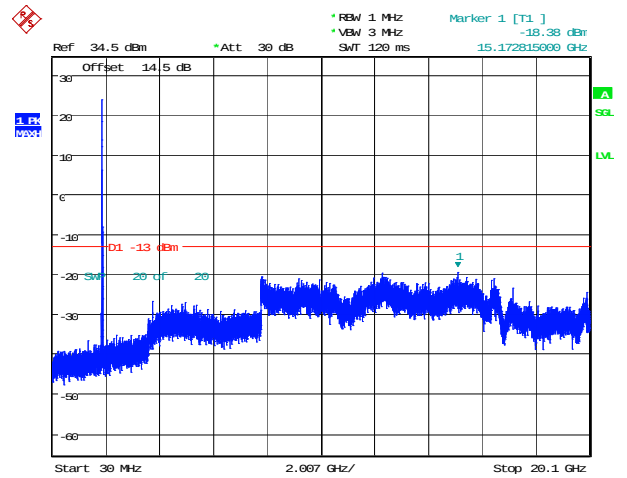


Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:17:58

20MHz_Low_QPSK_1@0(30MHz~20.1GHz)

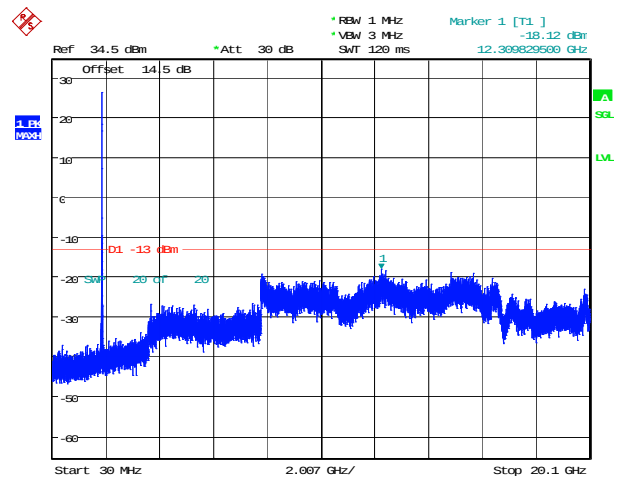

Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:19:29

20MHz_High_QPSK_1@0(30MHz~20.1GHz)

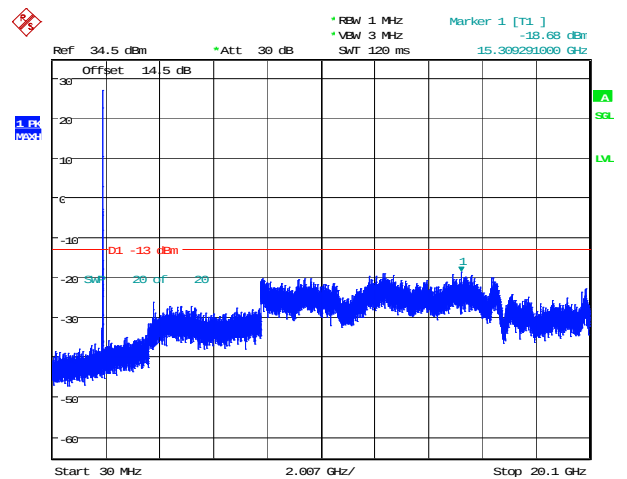

Comment: ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:20:57


FCC Part 27

LTE Band 4 , Normal

Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-19.41	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-18.72	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~18.55GHz)	-18.26	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-18.60	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-18.94	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~18.55GHz)	-19.05	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-18.58	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-33.04	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~18.55GHz)	-33.25	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-31.57	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-33.37	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~18.55GHz)	-31.27	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-30.47	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-32.68	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~18.55GHz)	-29.94	See Graphs	Pass
20MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-33.03	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-32.91	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~18.55GHz)	-33.02	See Graphs	Pass


Note:1RB was the worst case.

5MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

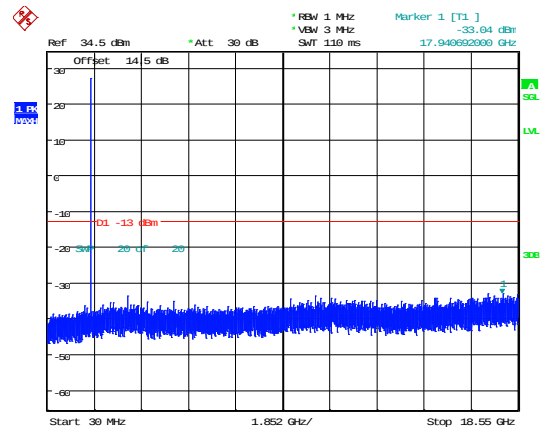


ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:43:17

10MHz_Low_QPSK_1@0(30MHz~18.55GHz)

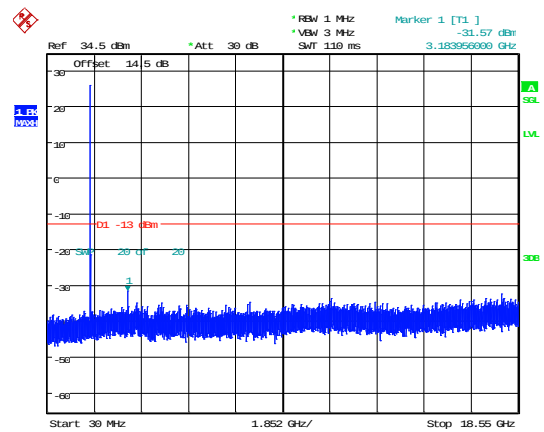


ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:40:38

10MHz_High_QPSK_1@0(30MHz~18.55GHz)

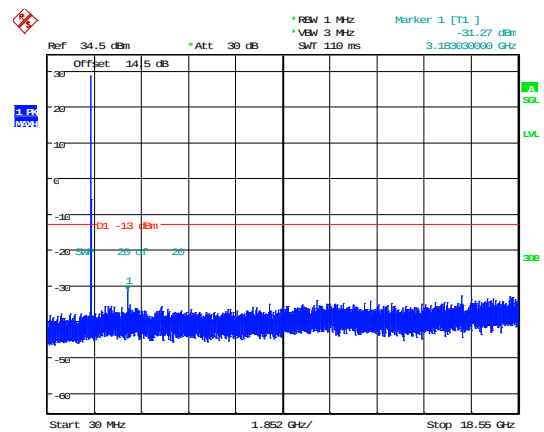


ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:41:27

15MHz_Low_QPSK_1@0(30MHz~18.55GHz)

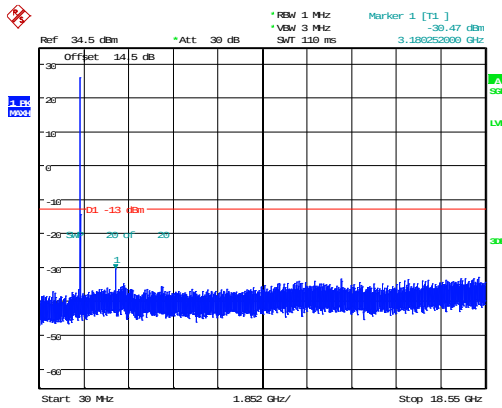


ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:43:44

15MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

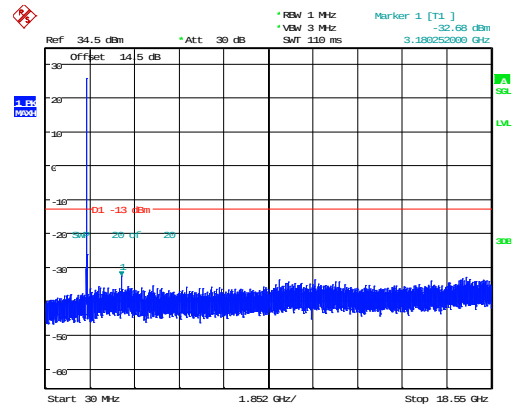


ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:44:12

15MHz_High_QPSK_1@0(30MHz~18.55GHz)

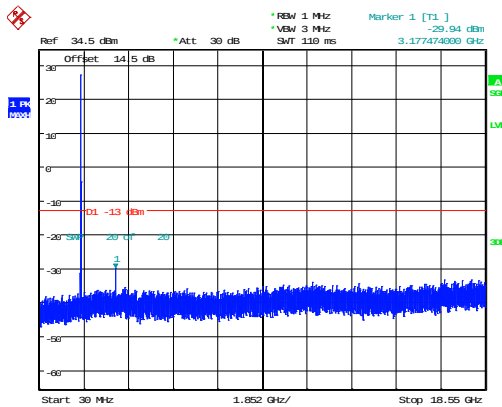


ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:44:36

20MHz_Low_QPSK_1@0(30MHz~18.55GHz)

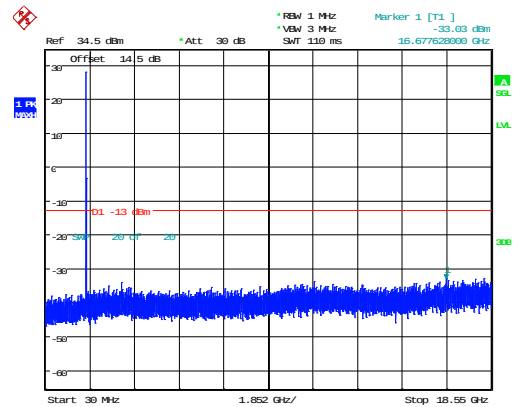


ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:45:04

20MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

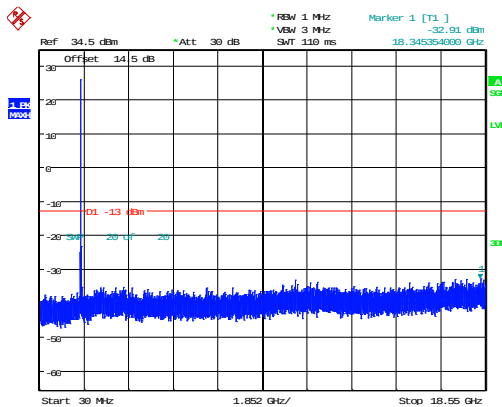

ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:45:29

20MHz_High_QPSK_1@0(30MHz~18.55GHz)

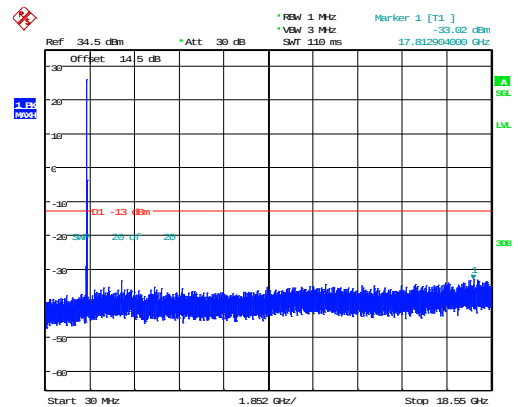

ProjectNo.:2503S02963E-RF Tester:Chin Qin
Date: 20.MAY.2025 22:45:53

***** END *****