



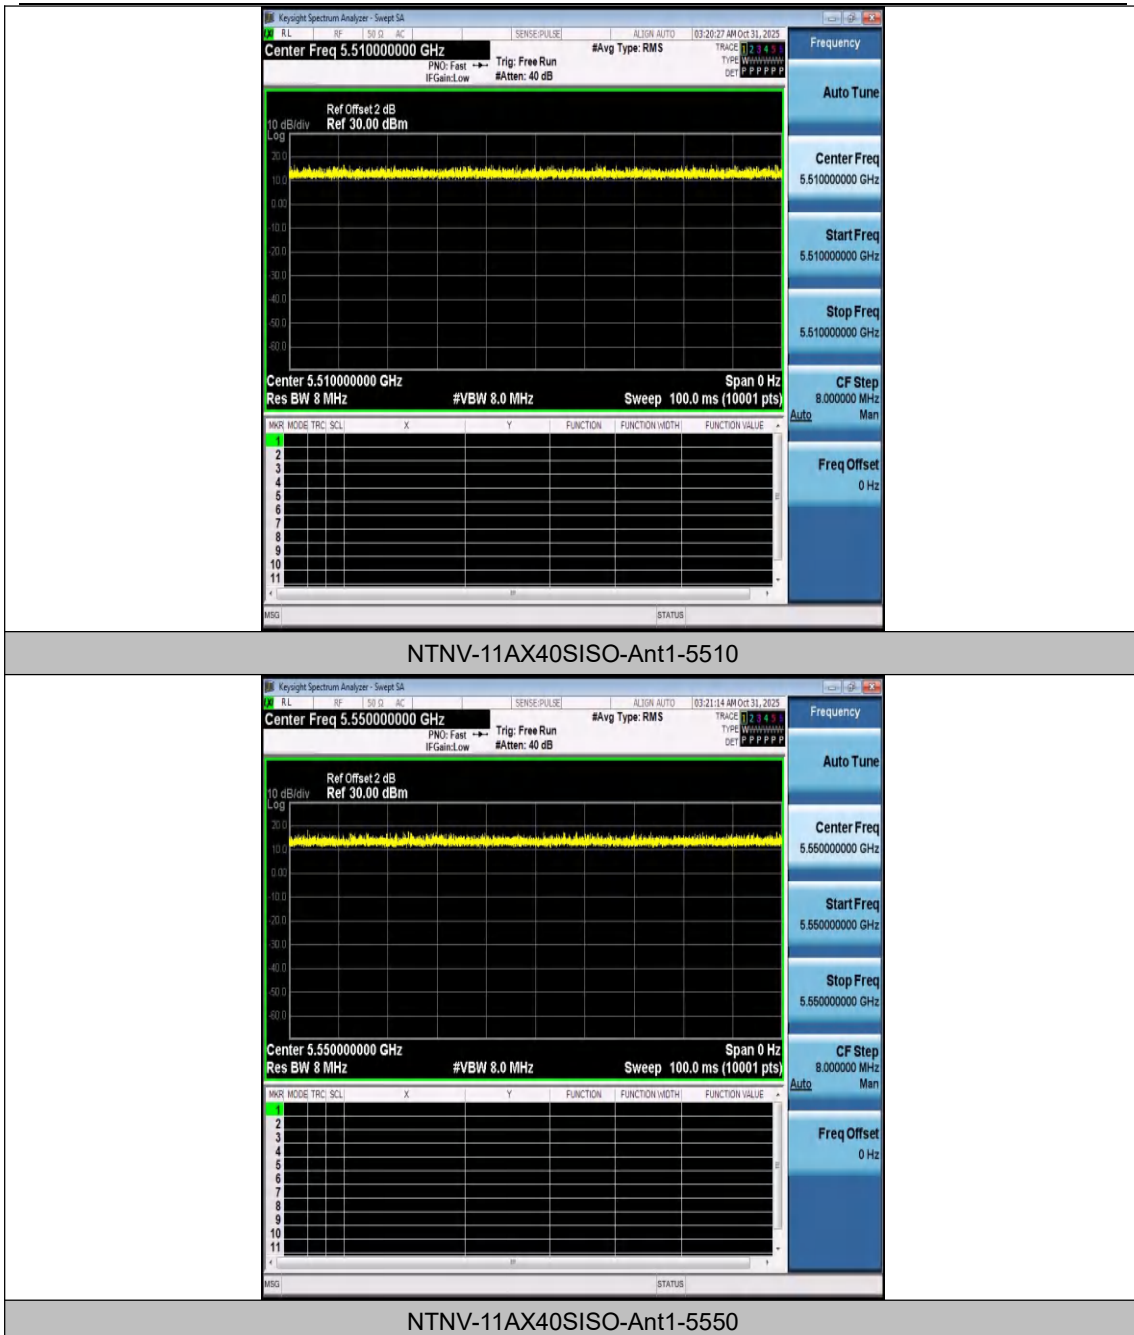

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

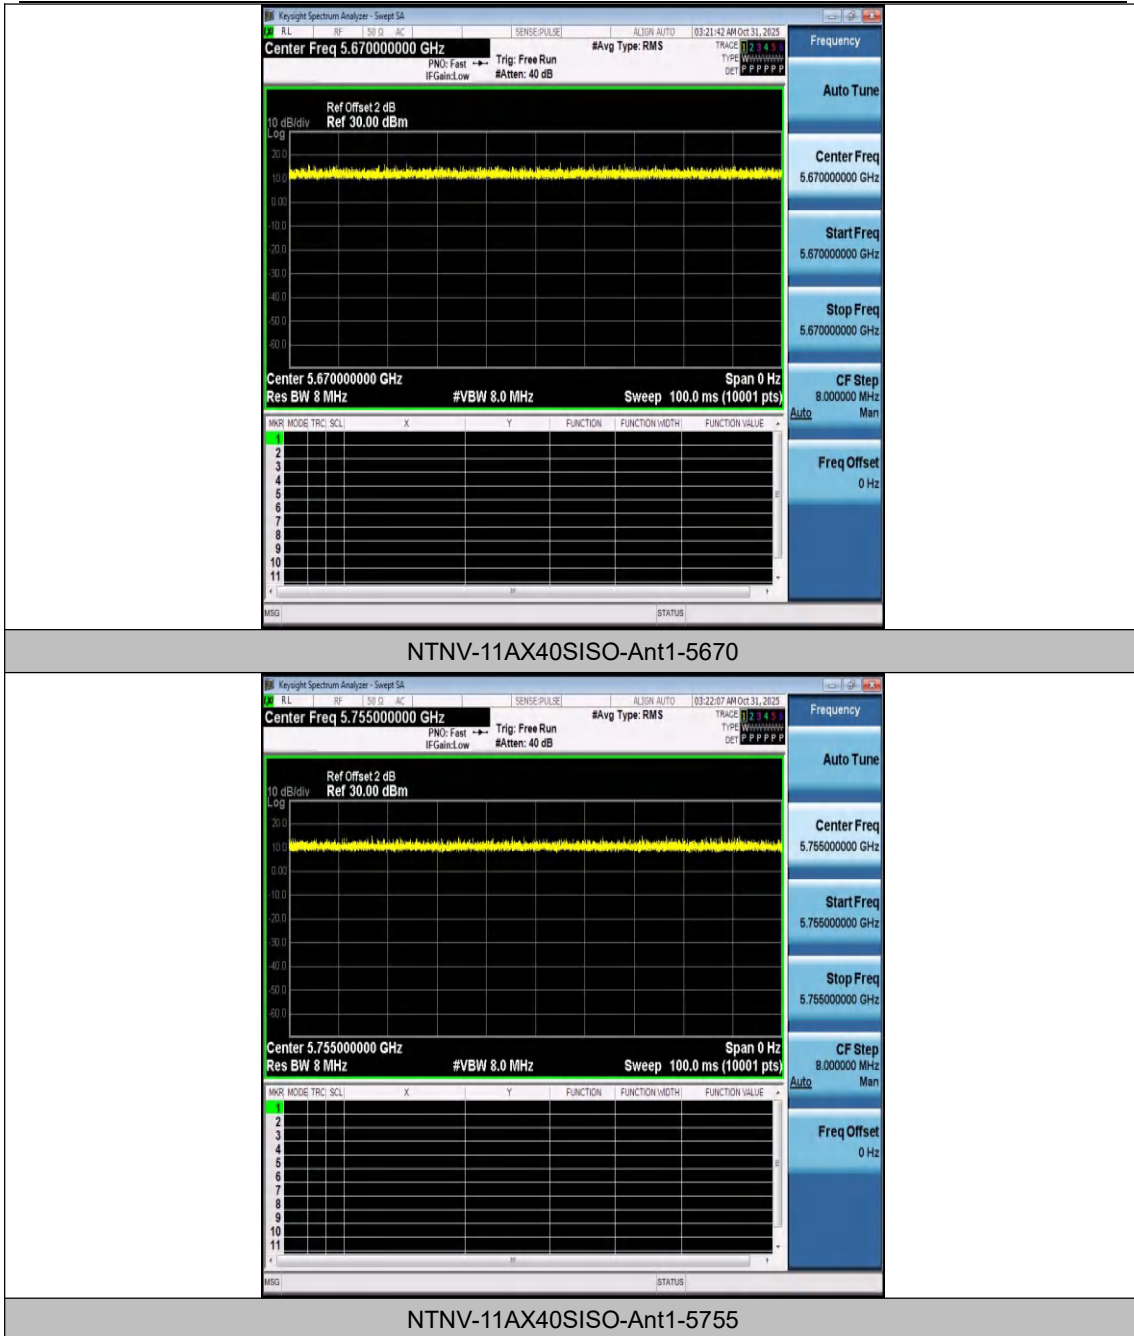


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

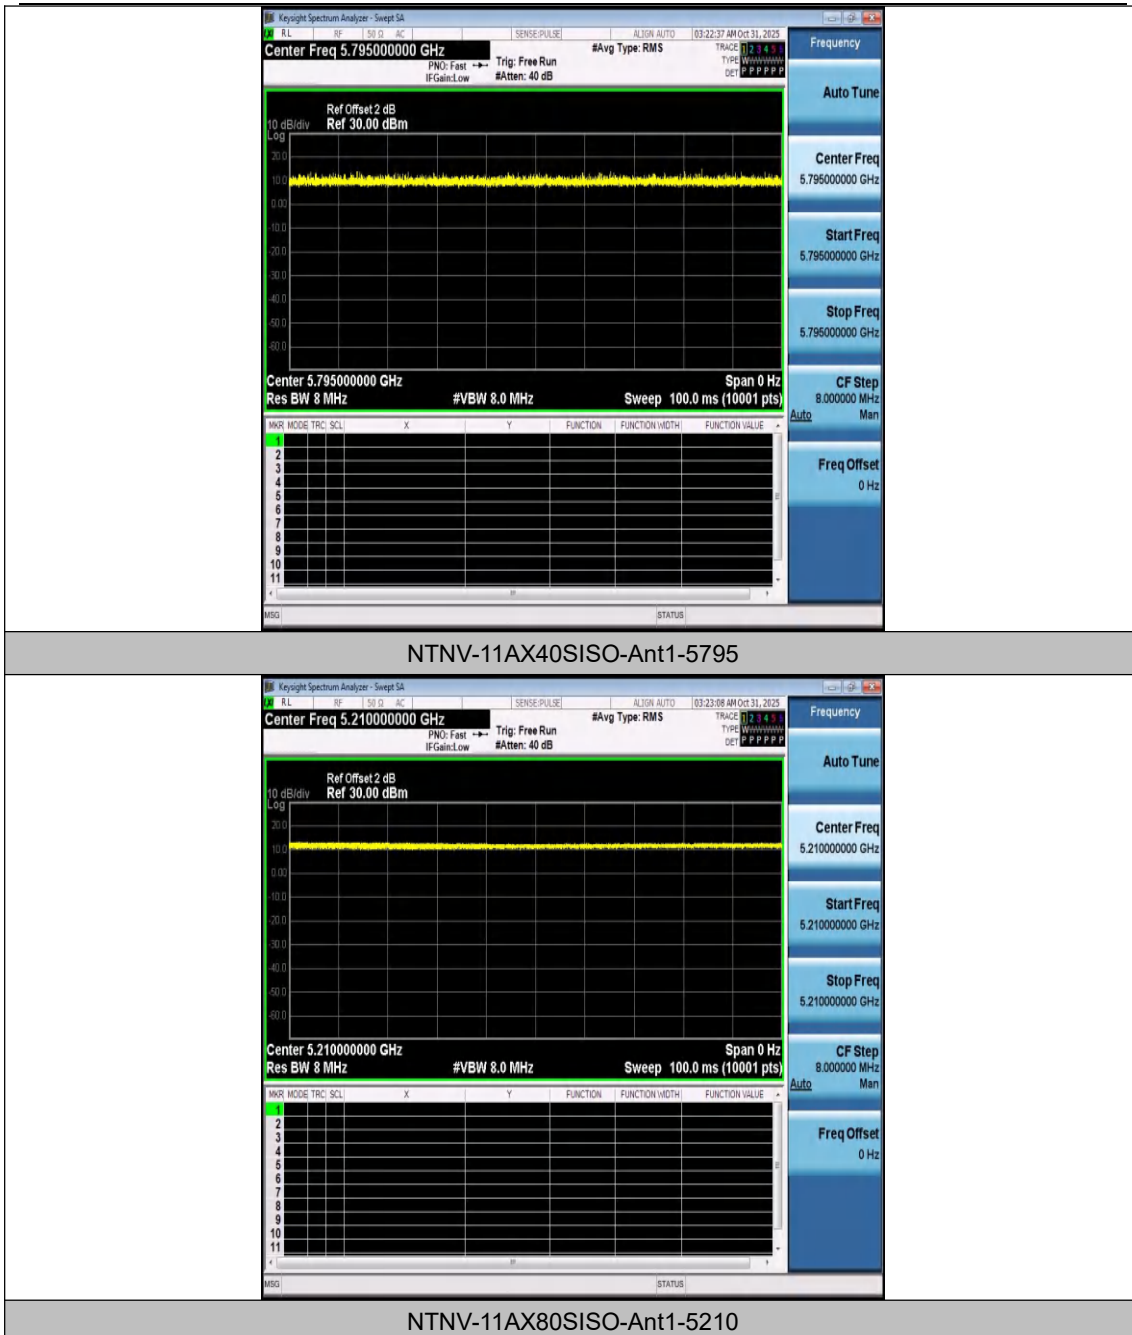


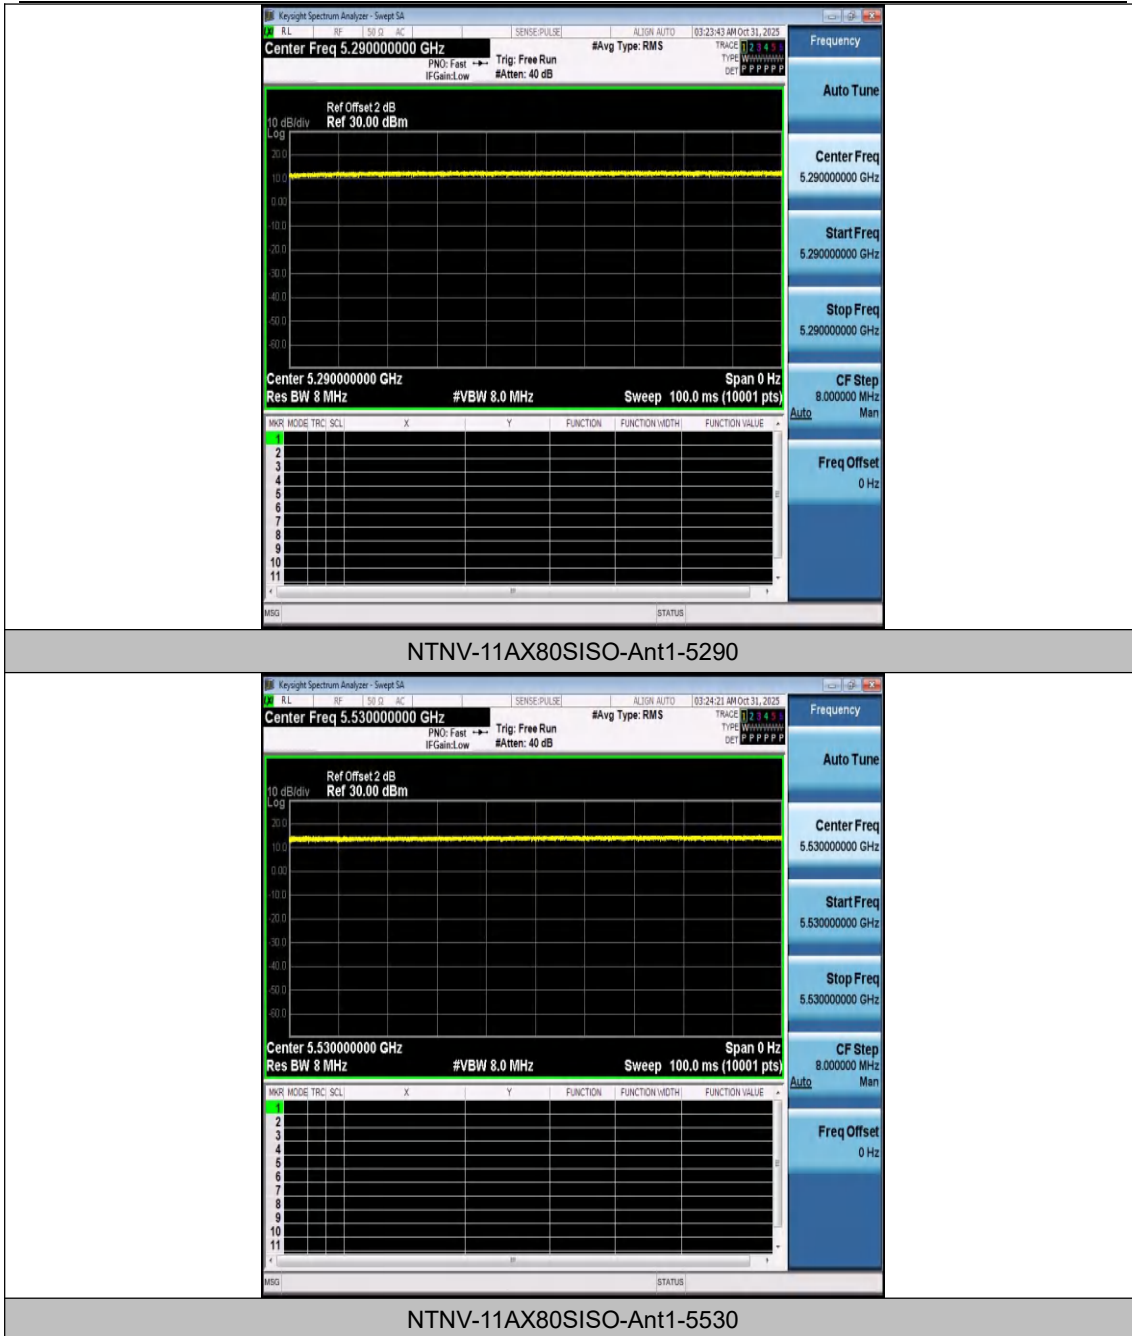

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

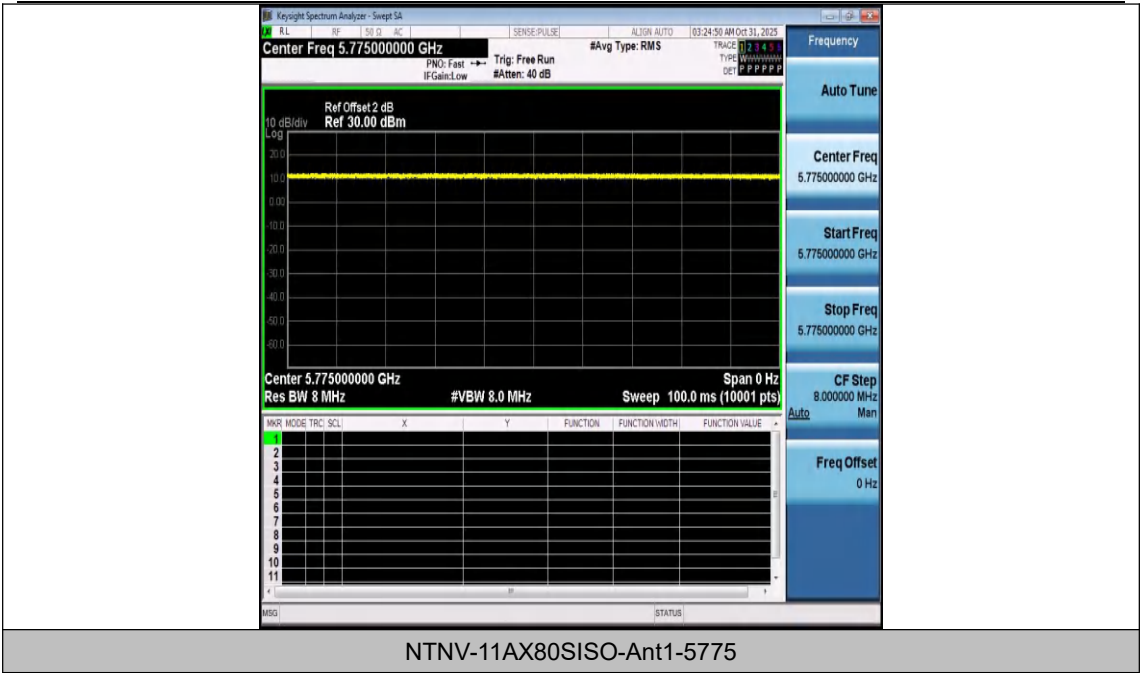

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency [MHz]	Set Power	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	---	14.64	100.00	0.00	14.64	≤23.98	PASS
11A	Ant1	5220	---	14.59	100.00	0.00	14.59	≤23.98	PASS
11A	Ant1	5240	---	14.26	100.00	0.00	14.26	≤23.98	PASS
11A	Ant1	5260	---	13.91	100.00	0.00	13.91	≤23.41	PASS
11A	Ant1	5300	---	14.47	100.00	0.00	14.47	≤23.42	PASS
11A	Ant1	5320	---	14.48	100.00	0.00	14.48	≤23.41	PASS
11A	Ant1	5500	---	14.67	100.00	0.00	14.67	≤23.41	PASS
11A	Ant1	5580	---	14.10	100.00	0.00	14.10	≤23.42	PASS
11A	Ant1	5700	---	14.58	100.00	0.00	14.58	≤23.42	PASS
11A	Ant1	5745	---	14.62	100.00	0.00	14.62	≤30.00	PASS
11A	Ant1	5785	---	14.88	100.00	0.00	14.88	≤30.00	PASS
11A	Ant1	5825	---	14.22	100.00	0.00	14.22	≤30.00	PASS
11N20SISO	Ant1	5180	---	14.00	100.00	0.00	14.00	≤23.98	PASS
11N20SISO	Ant1	5220	---	13.87	100.00	0.00	13.87	≤23.98	PASS
11N20SISO	Ant1	5240	---	14.63	100.00	0.00	14.63	≤23.98	PASS
11N20SISO	Ant1	5260	---	14.25	100.00	0.00	14.25	≤23.71	PASS
11N20SISO	Ant1	5300	---	13.85	100.00	0.00	13.85	≤23.70	PASS
11N20SISO	Ant1	5320	---	14.08	100.00	0.00	14.08	≤23.70	PASS
11N20SISO	Ant1	5500	---	13.91	100.00	0.00	13.91	≤23.71	PASS
11N20SISO	Ant1	5580	---	14.41	100.00	0.00	14.41	≤23.70	PASS
11N20SISO	Ant1	5700	---	14.74	100.00	0.00	14.74	≤23.70	PASS
11N20SISO	Ant1	5745	---	14.89	100.00	0.00	14.89	≤30.00	PASS
11N20SISO	Ant1	5785	---	14.09	100.00	0.00	14.09	≤30.00	PASS
11N20SISO	Ant1	5825	---	14.44	100.00	0.00	14.44	≤30.00	PASS
11N40SISO	Ant1	5190	---	14.99	100.00	0.00	14.99	≤23.98	PASS
11N40SISO	Ant1	5230	---	14.70	100.00	0.00	14.70	≤23.98	PASS
11N40SISO	Ant1	5270	---	14.21	100.00	0.00	14.21	≤23.98	PASS
11N40SISO	Ant1	5310	---	14.36	100.00	0.00	14.36	≤23.98	PASS
11N40SISO	Ant1	5510	---	14.10	100.00	0.00	14.10	≤23.98	PASS
11N40SISO	Ant1	5550	---	14.56	100.00	0.00	14.56	≤23.98	PASS
11N40SISO	Ant1	5670	---	14.72	100.00	0.00	14.72	≤23.98	PASS
11N40SISO	Ant1	5755	---	14.76	100.00	0.00	14.76	≤30.00	PASS
11N40SISO	Ant1	5795	---	14.03	100.00	0.00	14.03	≤30.00	PASS
11AC20SISO	Ant1	5180	---	13.93	100.00	0.00	13.93	≤23.98	PASS
11AC20SISO	Ant1	5220	---	14.77	100.00	0.00	14.77	≤23.98	PASS
11AC20SISO	Ant1	5240	---	14.60	100.00	0.00	14.60	≤23.98	PASS

11AC20SISO	Ant1	5260	---	14.16	100.00	0.00	14.16	≤23.71	PASS
11AC20SISO	Ant1	5300	---	14.87	100.00	0.00	14.87	≤23.70	PASS
11AC20SISO	Ant1	5320	---	14.96	100.00	0.00	14.96	≤23.70	PASS
11AC20SISO	Ant1	5500	---	14.73	100.00	0.00	14.73	≤23.71	PASS
11AC20SISO	Ant1	5580	---	14.12	100.00	0.00	14.12	≤23.70	PASS
11AC20SISO	Ant1	5700	---	14.62	100.00	0.00	14.62	≤23.70	PASS
11AC20SISO	Ant1	5745	---	14.68	100.00	0.00	14.68	≤30.00	PASS
11AC20SISO	Ant1	5785	---	13.95	100.00	0.00	13.95	≤30.00	PASS
11AC20SISO	Ant1	5825	---	14.29	100.00	0.00	14.29	≤30.00	PASS
11AC40SISO	Ant1	5190	---	14.84	100.00	0.00	14.84	≤23.98	PASS
11AC40SISO	Ant1	5230	---	14.65	100.00	0.00	14.65	≤23.98	PASS
11AC40SISO	Ant1	5270	---	14.06	100.00	0.00	14.06	≤23.98	PASS
11AC40SISO	Ant1	5310	---	14.18	100.00	0.00	14.18	≤23.98	PASS
11AC40SISO	Ant1	5510	---	14.89	100.00	0.00	14.89	≤23.98	PASS
11AC40SISO	Ant1	5550	---	14.49	100.00	0.00	14.49	≤23.98	PASS
11AC40SISO	Ant1	5670	---	14.60	100.00	0.00	14.60	≤23.98	PASS
11AC40SISO	Ant1	5755	---	14.76	100.00	0.00	14.76	≤30.00	PASS
11AC40SISO	Ant1	5795	---	14.01	100.00	0.00	14.01	≤30.00	PASS
11AC80SISO	Ant1	5210	---	13.87	100.00	0.00	13.87	≤23.98	PASS
11AC80SISO	Ant1	5290	---	14.63	100.00	0.00	14.63	≤23.98	PASS
11AC80SISO	Ant1	5530	---	13.82	100.00	0.00	13.82	≤23.98	PASS
11AC80SISO	Ant1	5775	---	14.03	100.00	0.00	14.03	≤30.00	PASS
11AX20SISO	Ant1	5180	---	13.95	100.00	0.00	13.95	≤23.98	PASS
11AX20SISO	Ant1	5220	---	14.67	100.00	0.00	14.67	≤23.98	PASS
11AX20SISO	Ant1	5240	---	14.59	100.00	0.00	14.59	≤23.98	PASS
11AX20SISO	Ant1	5260	---	14.13	100.00	0.00	14.13	≤23.98	PASS
11AX20SISO	Ant1	5300	---	14.75	100.00	0.00	14.75	≤23.98	PASS
11AX20SISO	Ant1	5320	---	14.98	100.00	0.00	14.98	≤23.98	PASS
11AX20SISO	Ant1	5500	---	14.64	100.00	0.00	14.64	≤23.98	PASS
11AX20SISO	Ant1	5580	---	14.07	100.00	0.00	14.07	≤23.98	PASS
11AX20SISO	Ant1	5700	---	14.61	100.00	0.00	14.61	≤23.98	PASS
11AX20SISO	Ant1	5745	---	14.61	100.00	0.00	14.61	≤30.00	PASS
11AX20SISO	Ant1	5785	---	14.86	100.00	0.00	14.86	≤30.00	PASS
11AX20SISO	Ant1	5825	---	14.23	100.00	0.00	14.23	≤30.00	PASS
11AX40SISO	Ant1	5190	---	14.48	100.00	0.00	14.48	≤23.98	PASS
11AX40SISO	Ant1	5230	---	14.34	100.00	0.00	14.34	≤23.98	PASS
11AX40SISO	Ant1	5270	---	14.64	100.00	0.00	14.64	≤23.98	PASS
11AX40SISO	Ant1	5310	---	14.79	100.00	0.00	14.79	≤23.98	PASS
11AX40SISO	Ant1	5510	---	14.46	100.00	0.00	14.46	≤23.98	PASS
11AX40SISO	Ant1	5550	---	14.02	100.00	0.00	14.02	≤23.98	PASS
11AX40SISO	Ant1	5670	---	14.27	100.00	0.00	14.27	≤23.98	PASS
11AX40SISO	Ant1	5755	---	14.37	100.00	0.00	14.37	≤30.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AX40SISO	Ant1	5795	---	14.66	100.00	0.00	14.66	≤30.00	PASS
11AX80SISO	Ant1	5210	---	14.53	100.00	0.00	14.53	≤23.98	PASS
11AX80SISO	Ant1	5290	---	14.33	100.00	0.00	14.33	≤23.98	PASS
11AX80SISO	Ant1	5530	---	13.99	100.00	0.00	13.99	≤23.98	PASS
11AX80SISO	Ant1	5775	---	14.80	100.00	0.00	14.80	≤30.00	PASS

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.

Test Graphs Channel Power

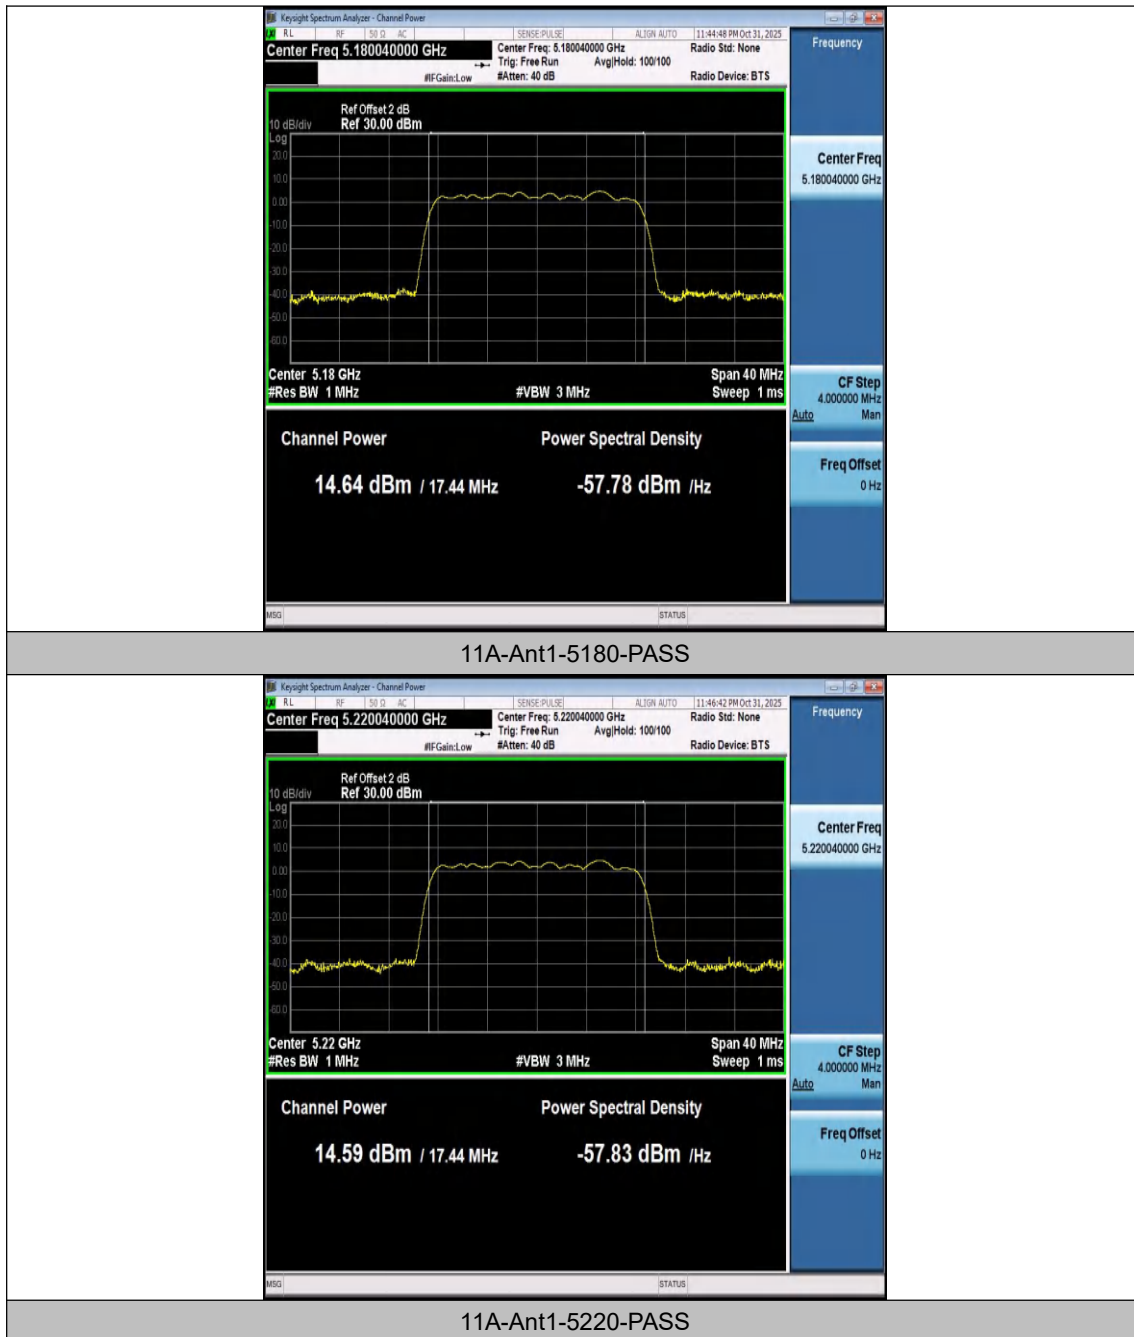

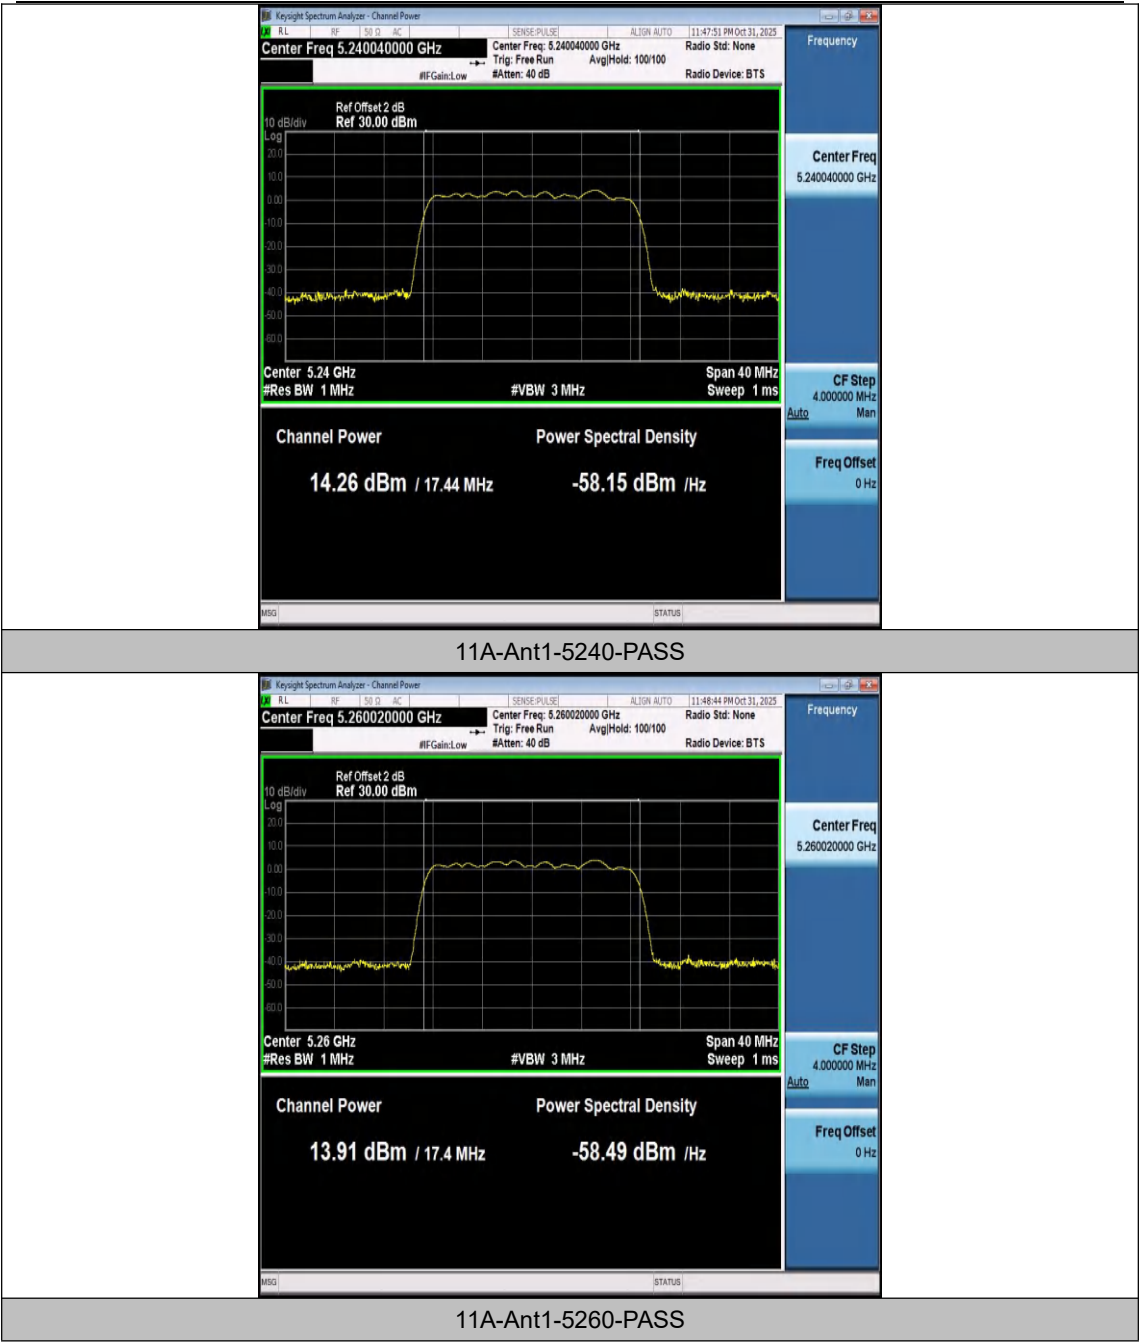


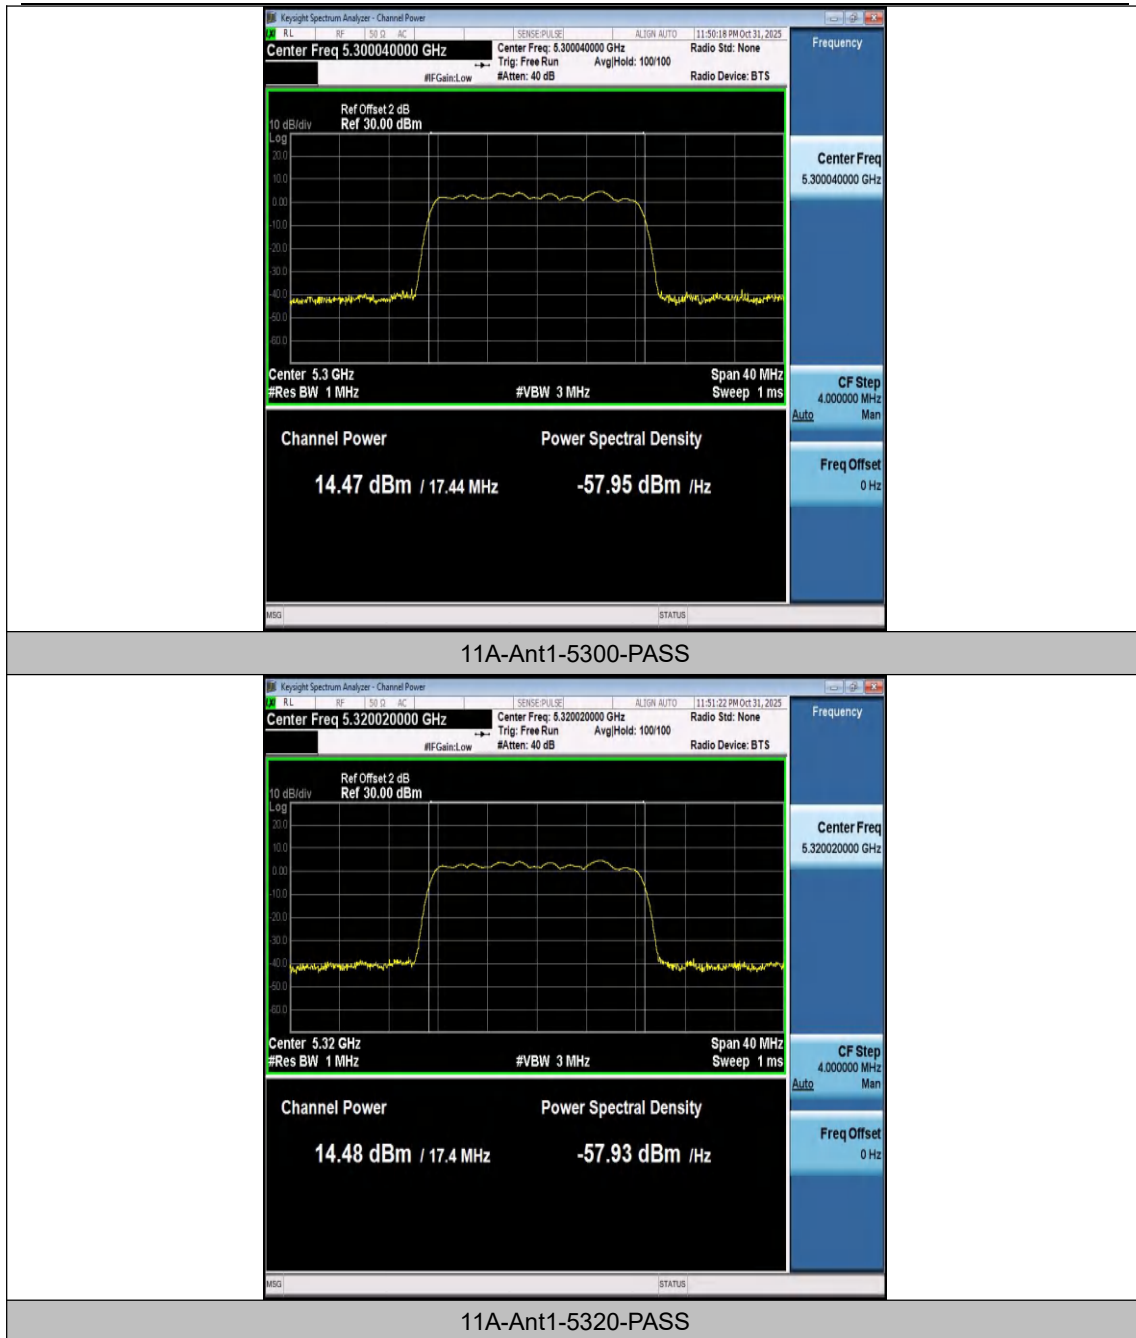

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

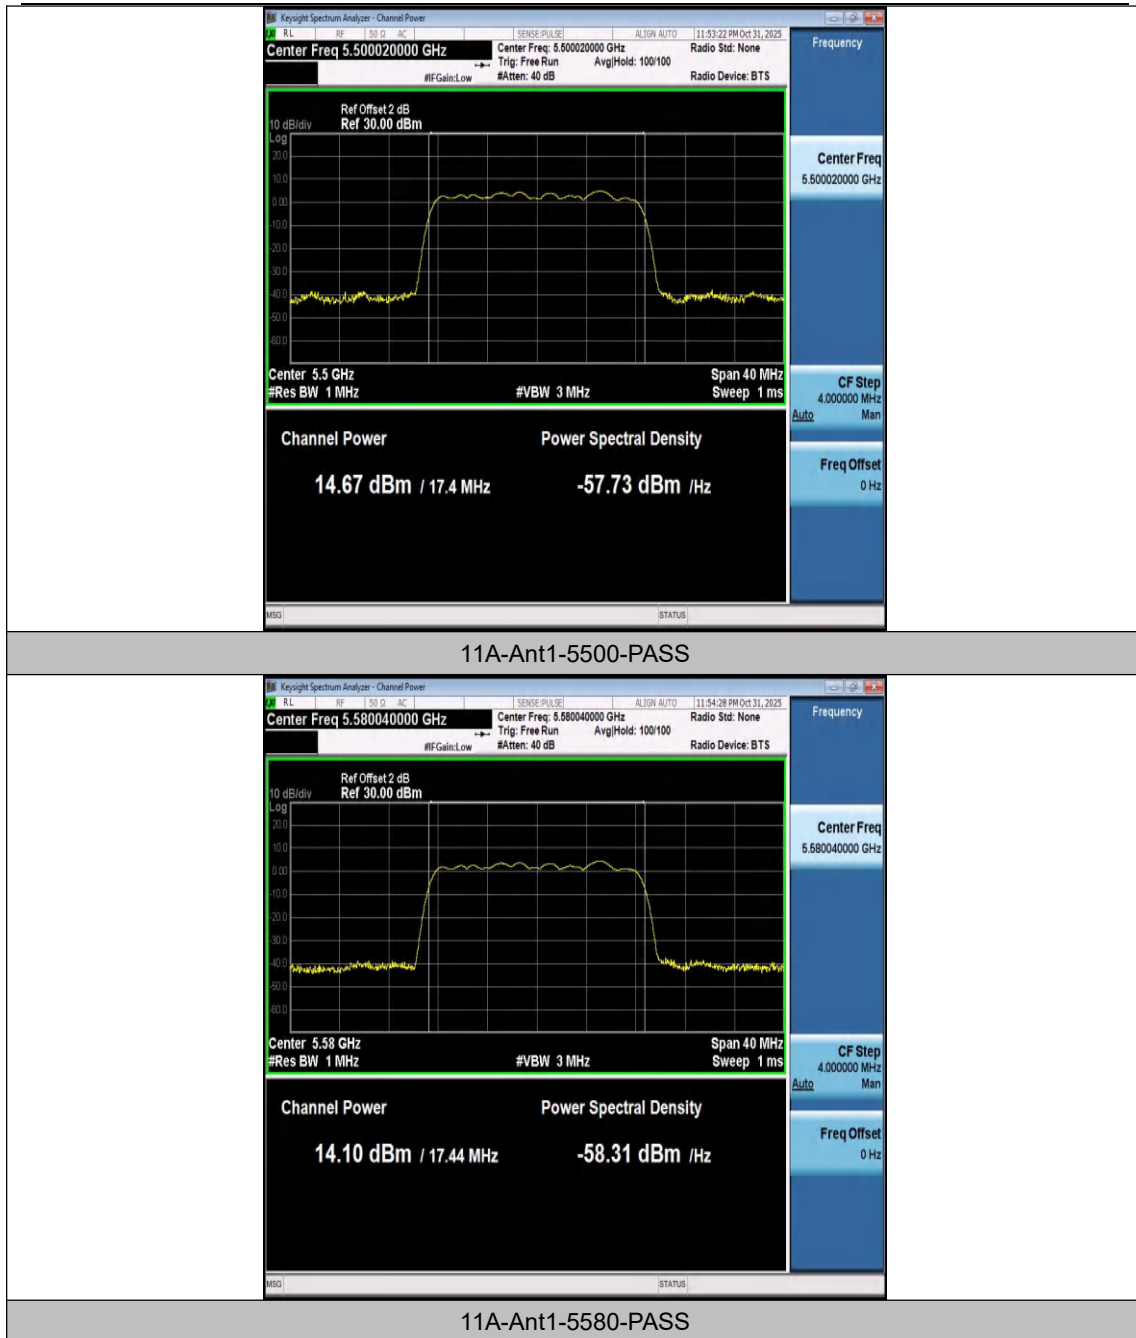

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

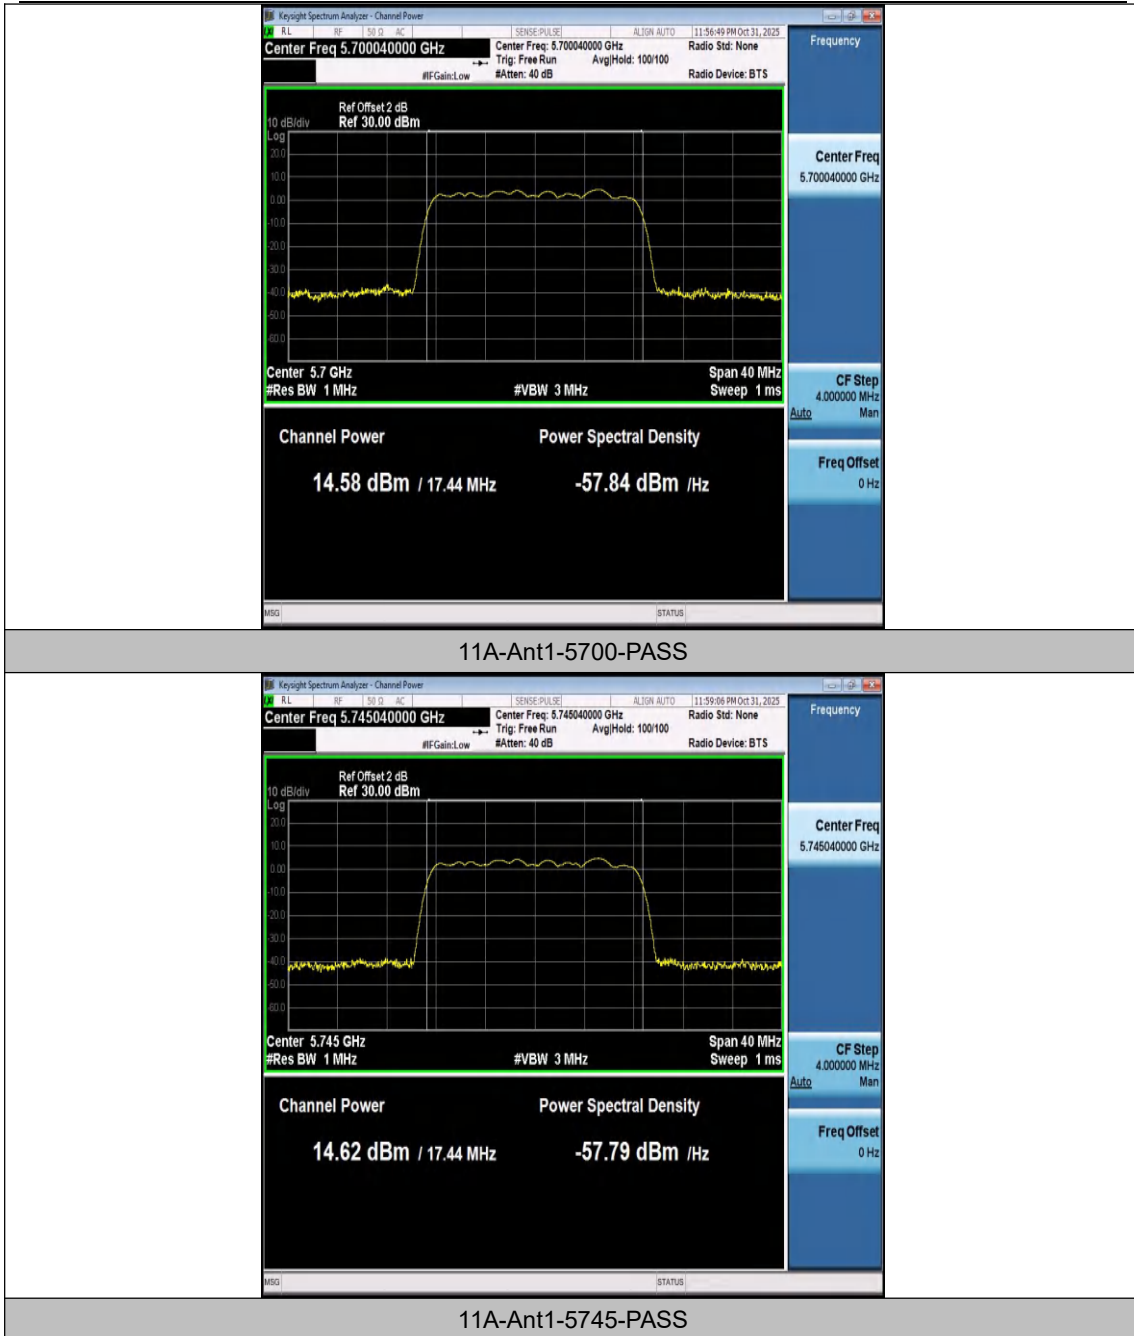

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

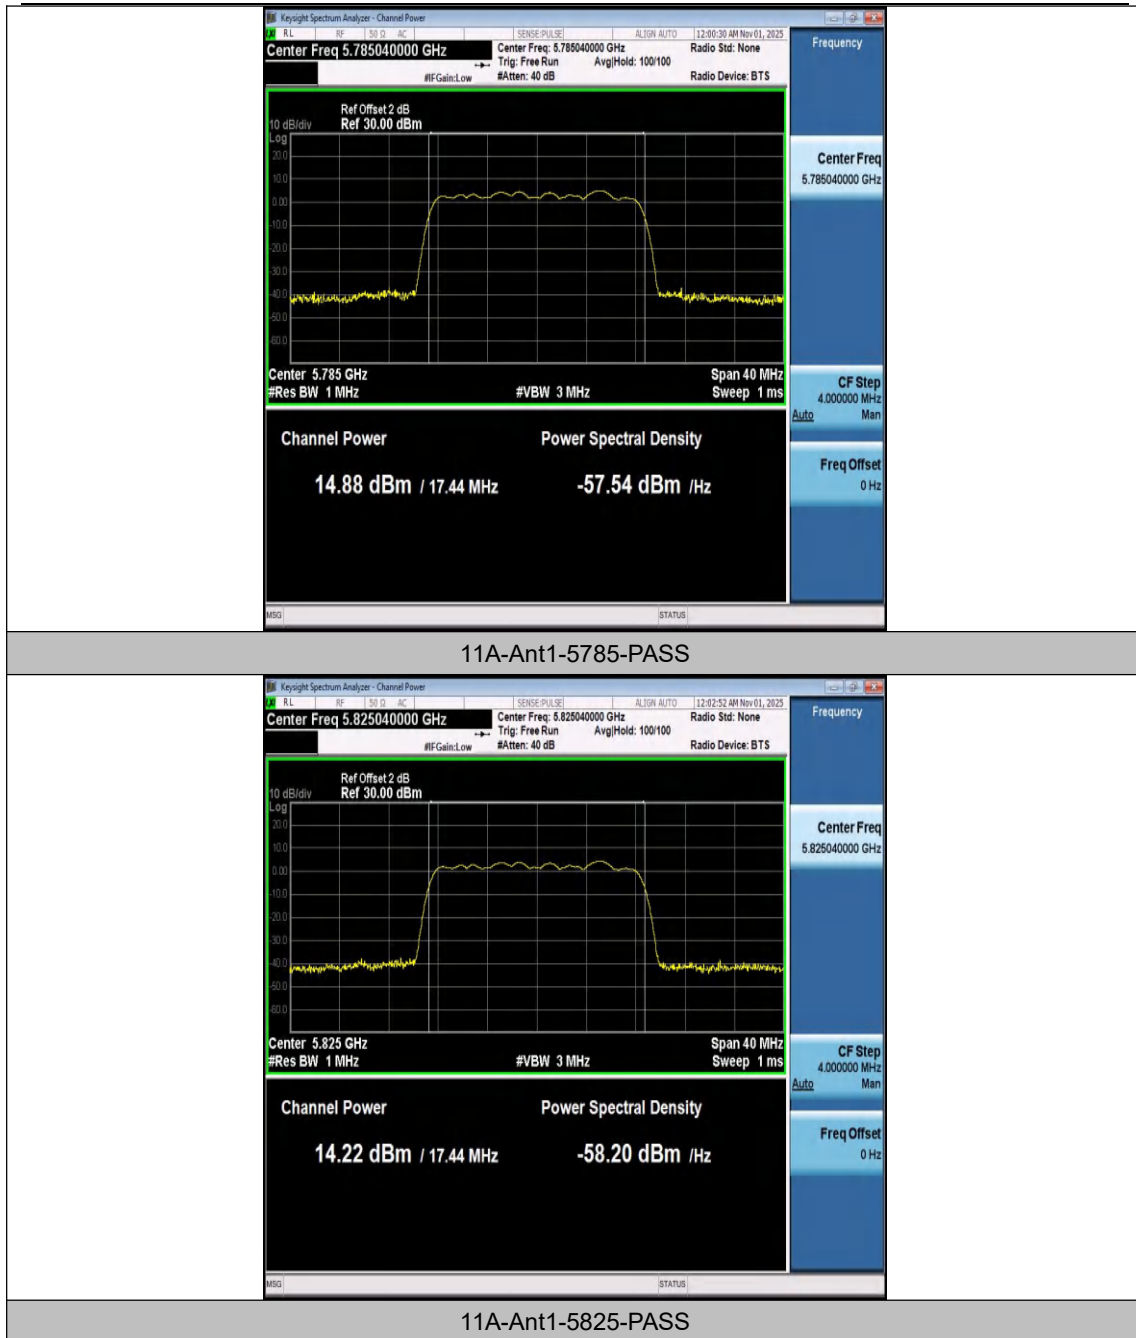

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

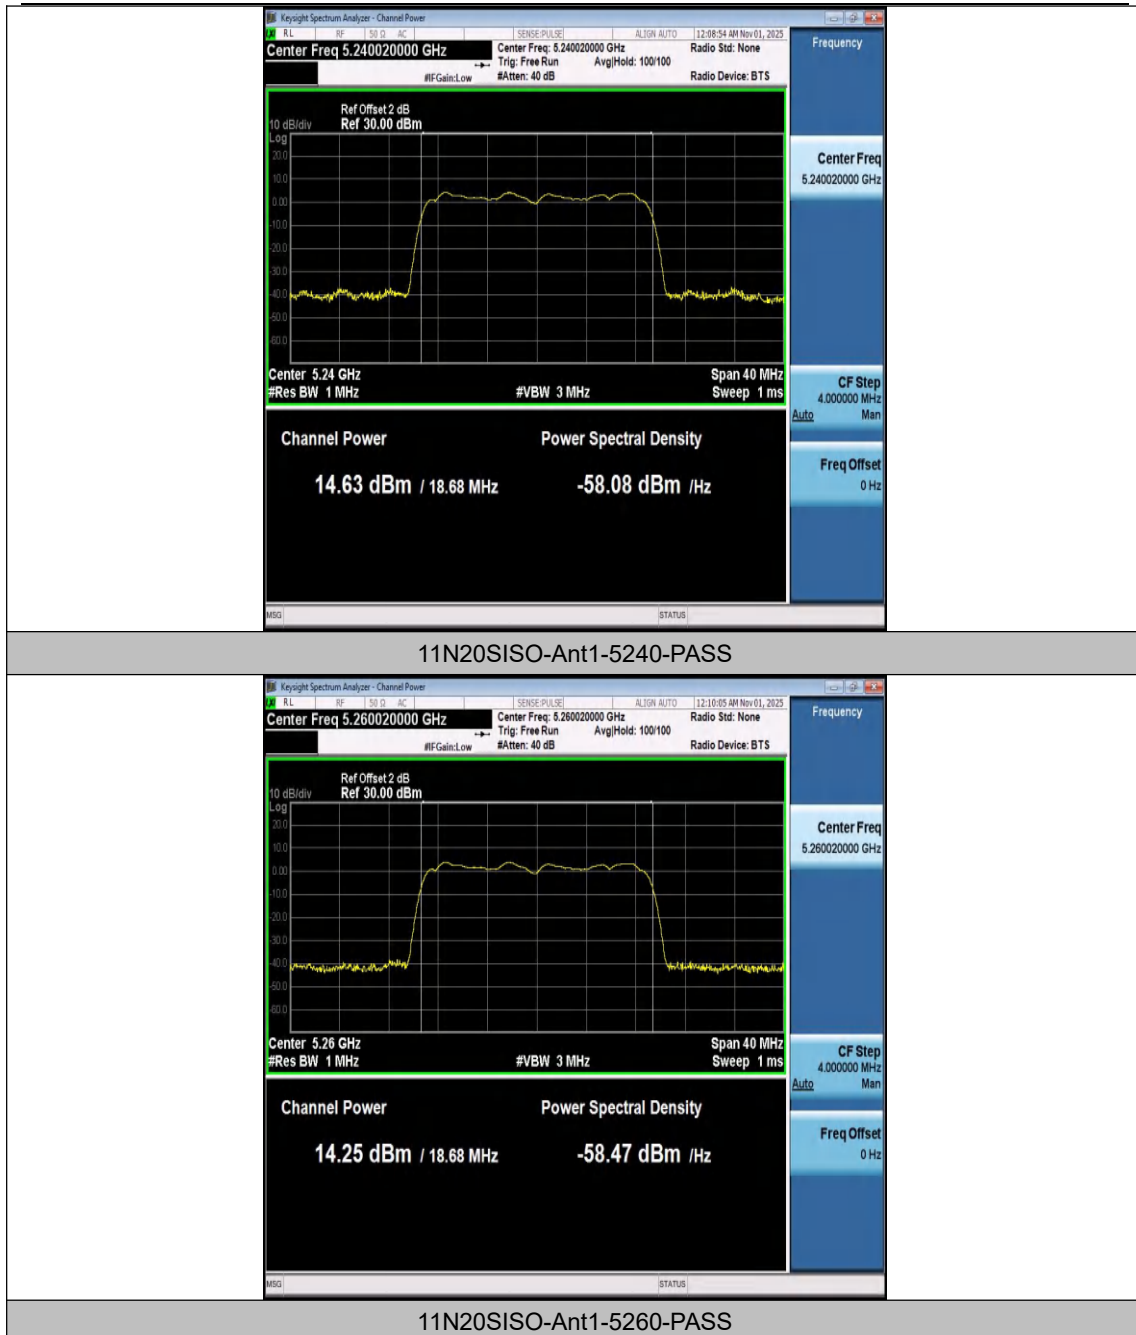



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

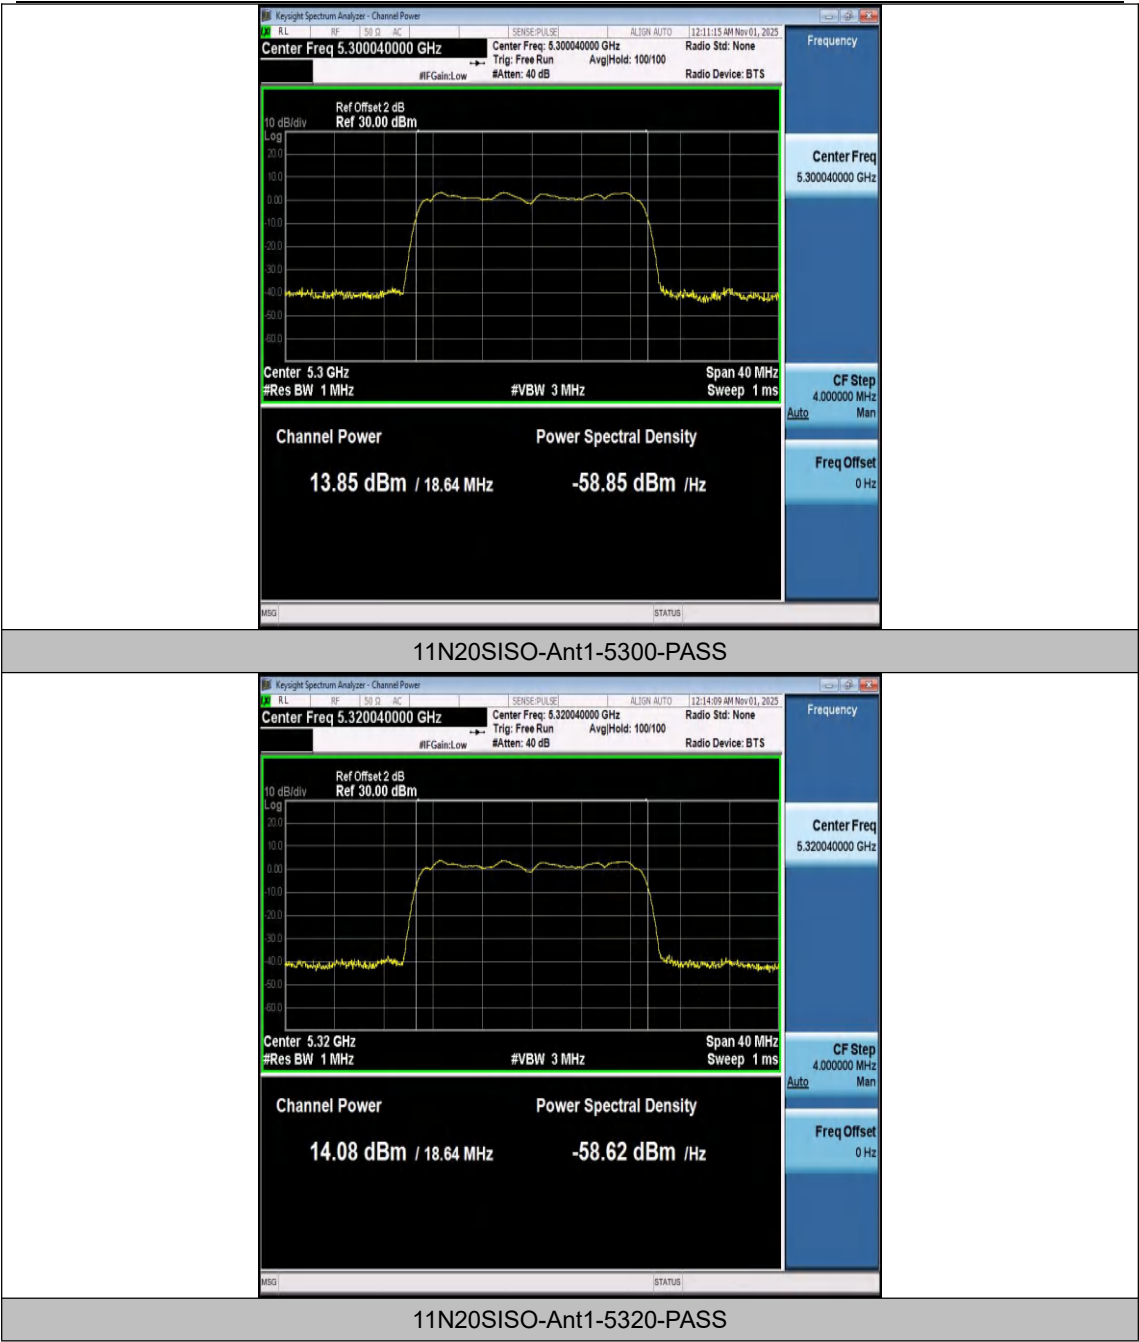

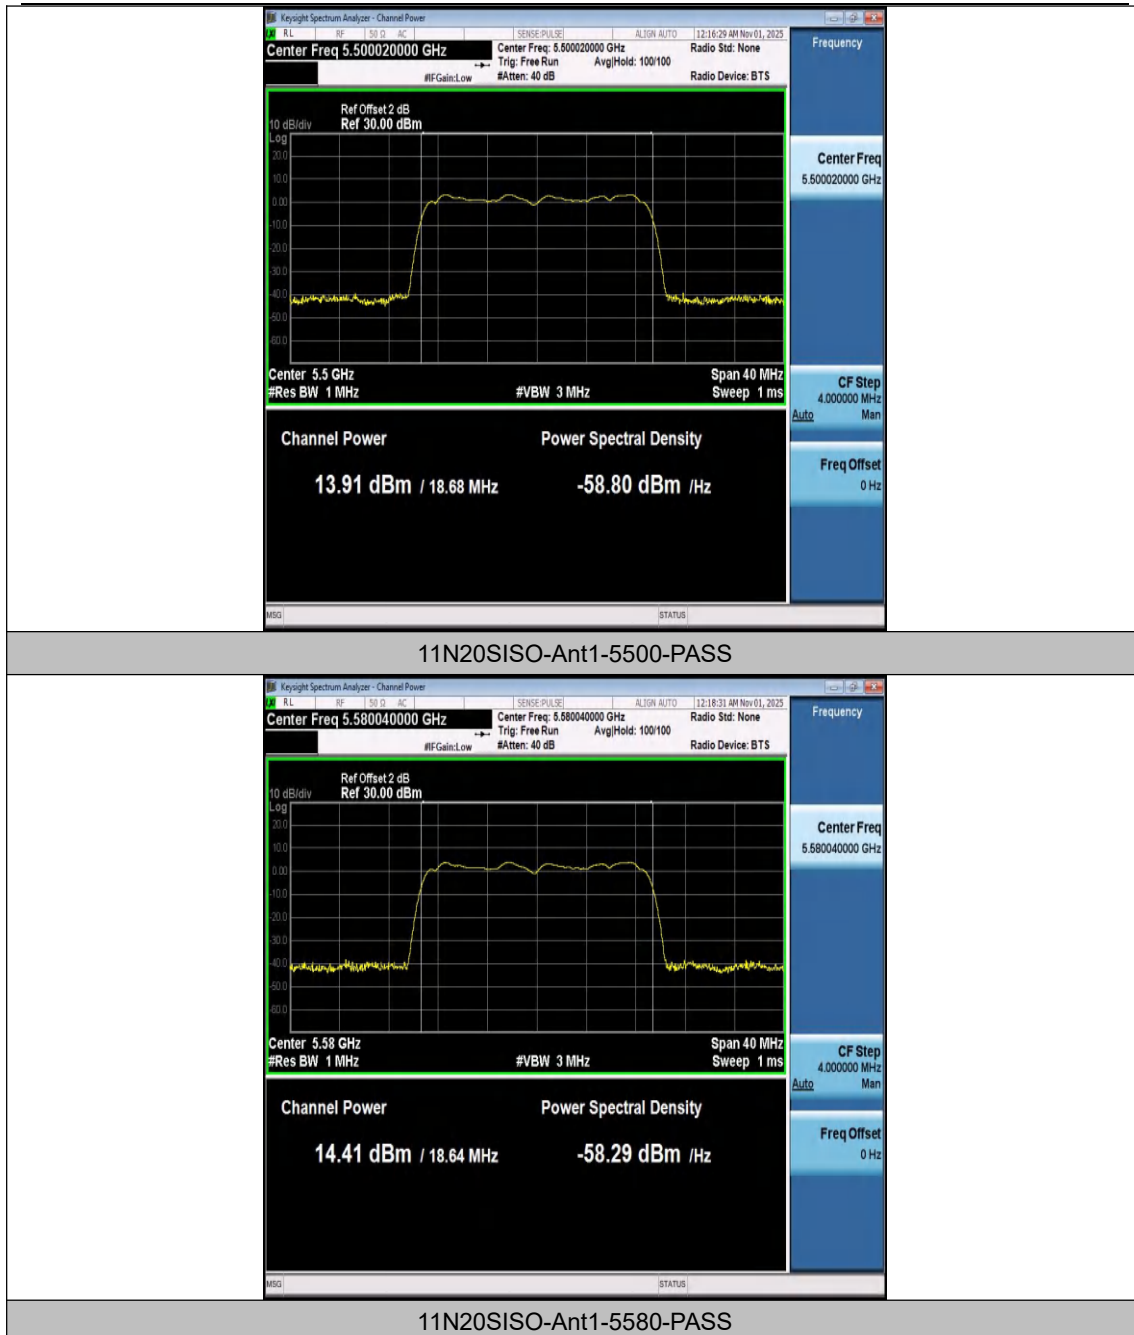


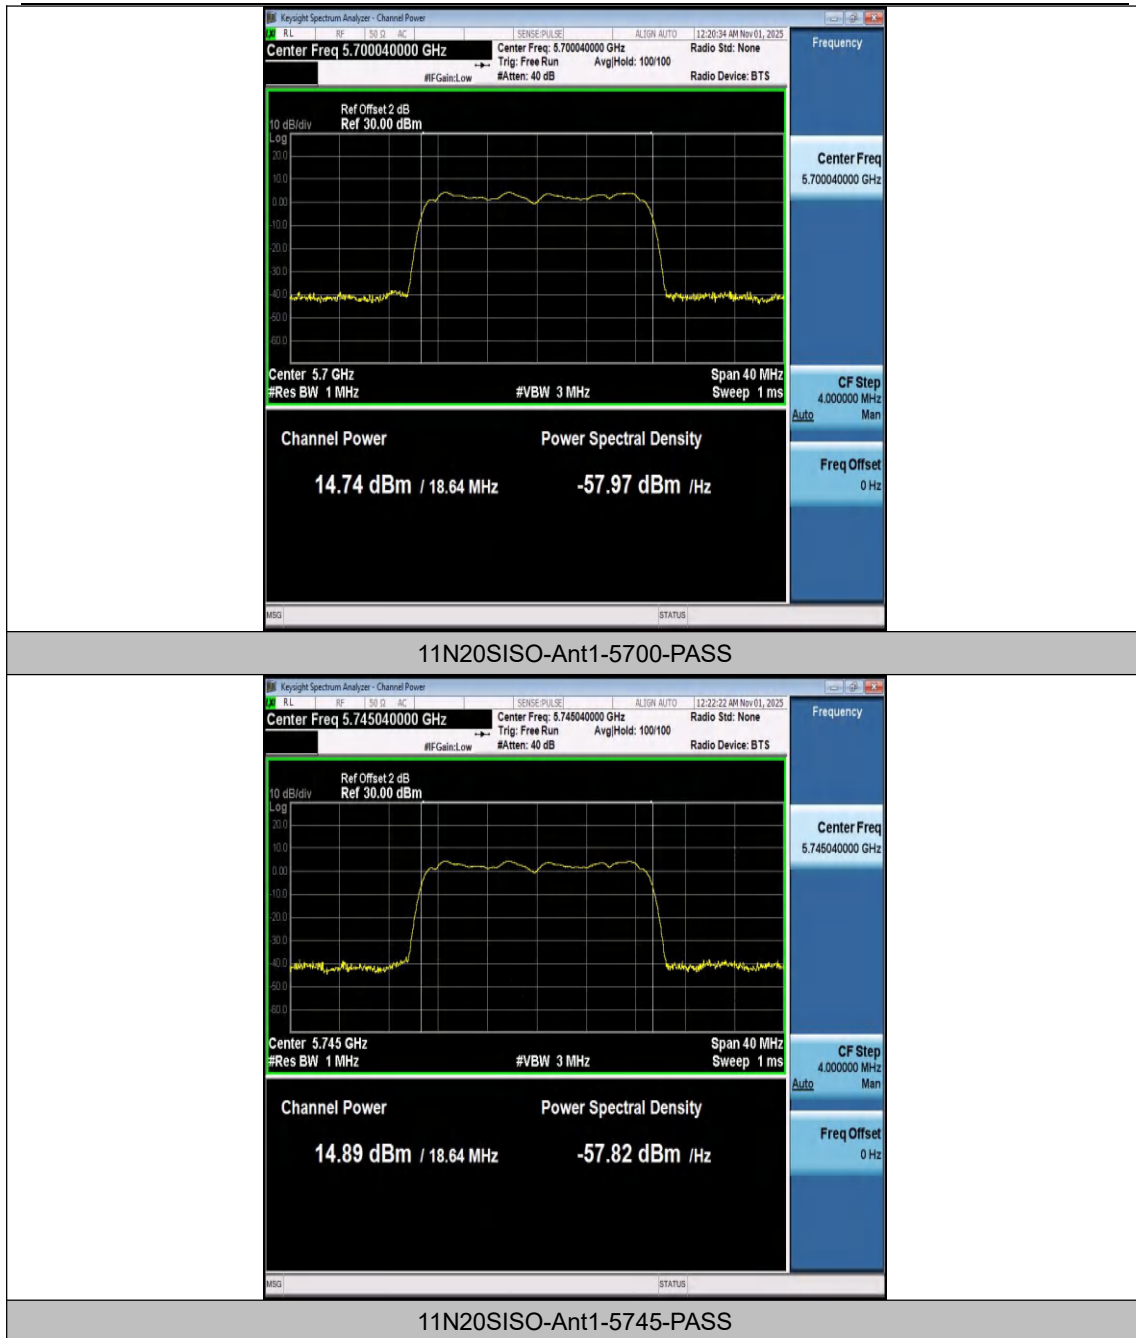

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

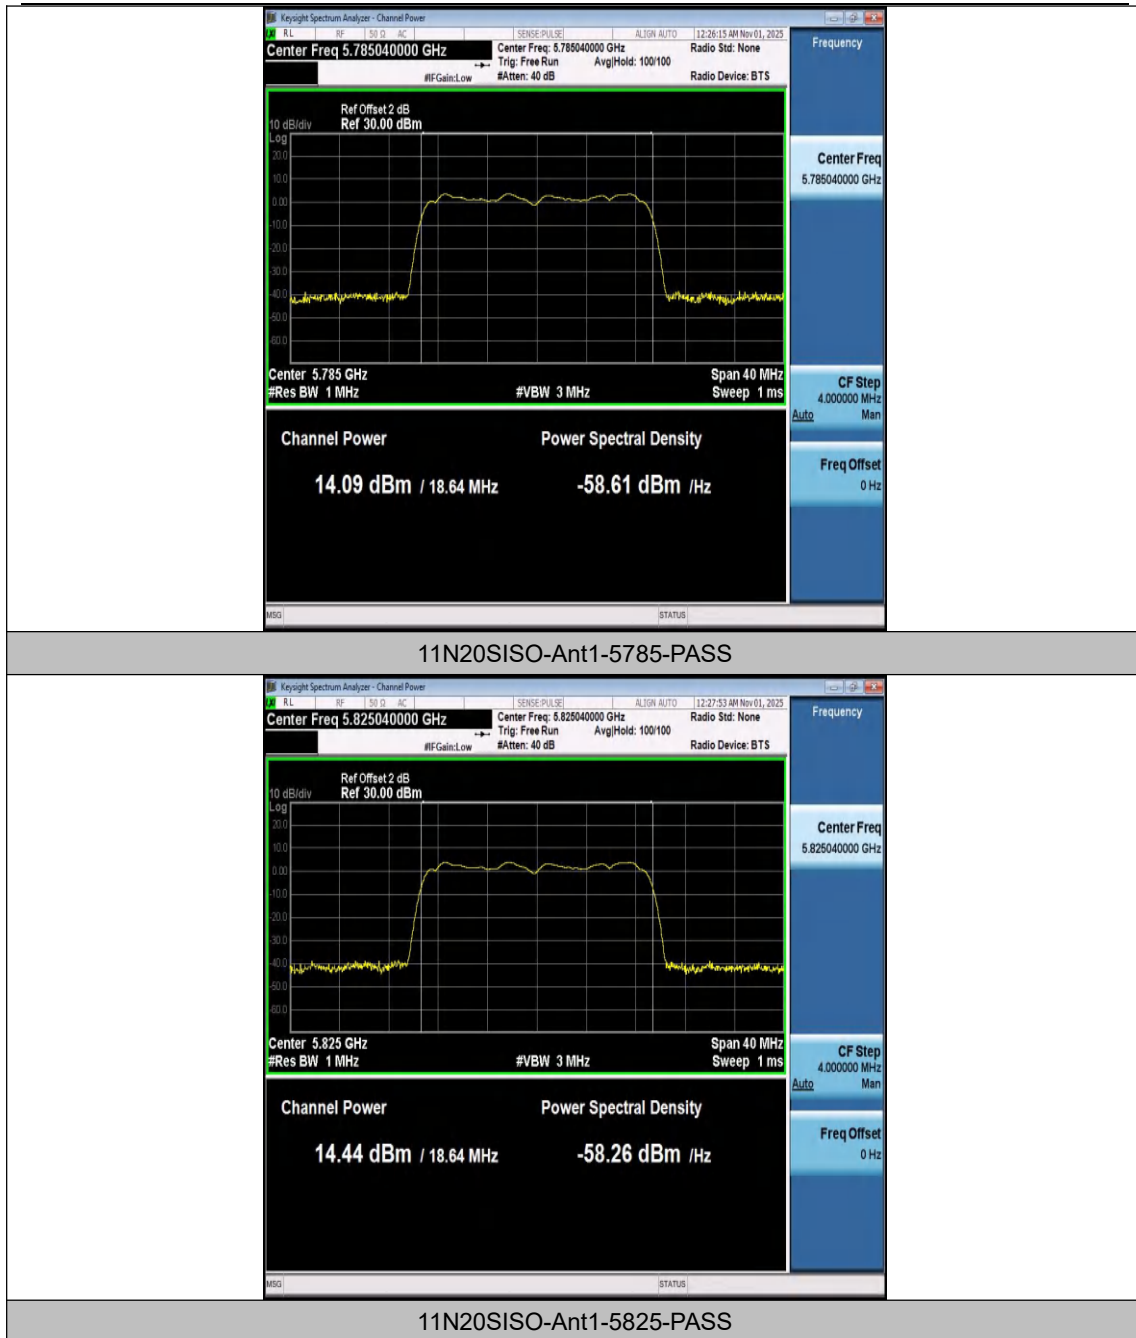


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

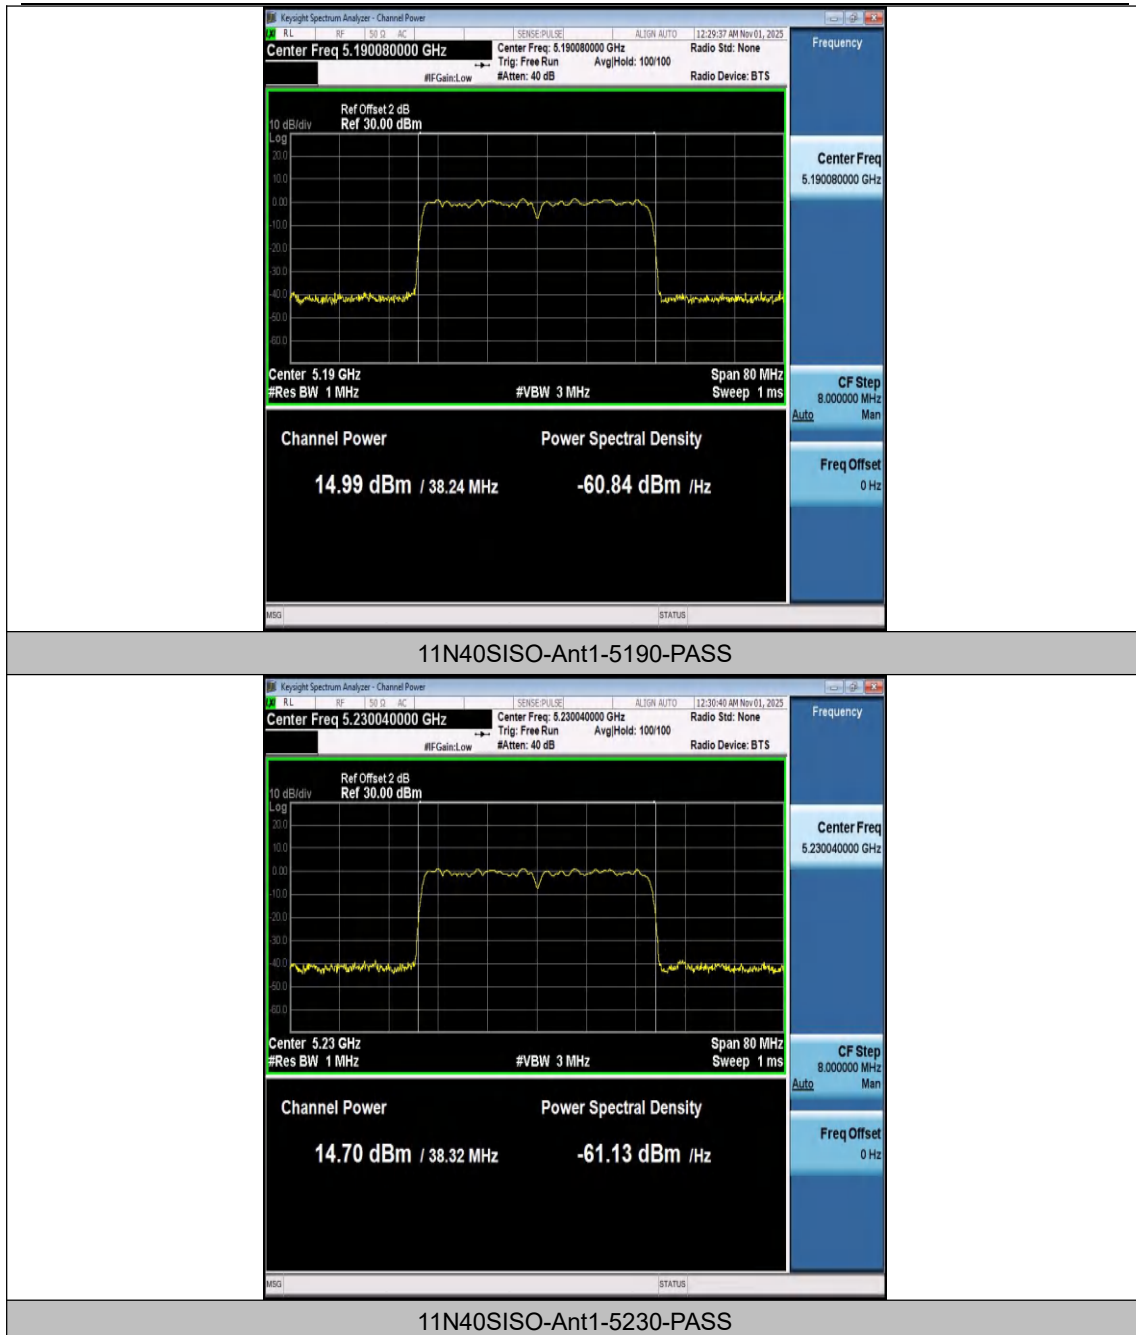


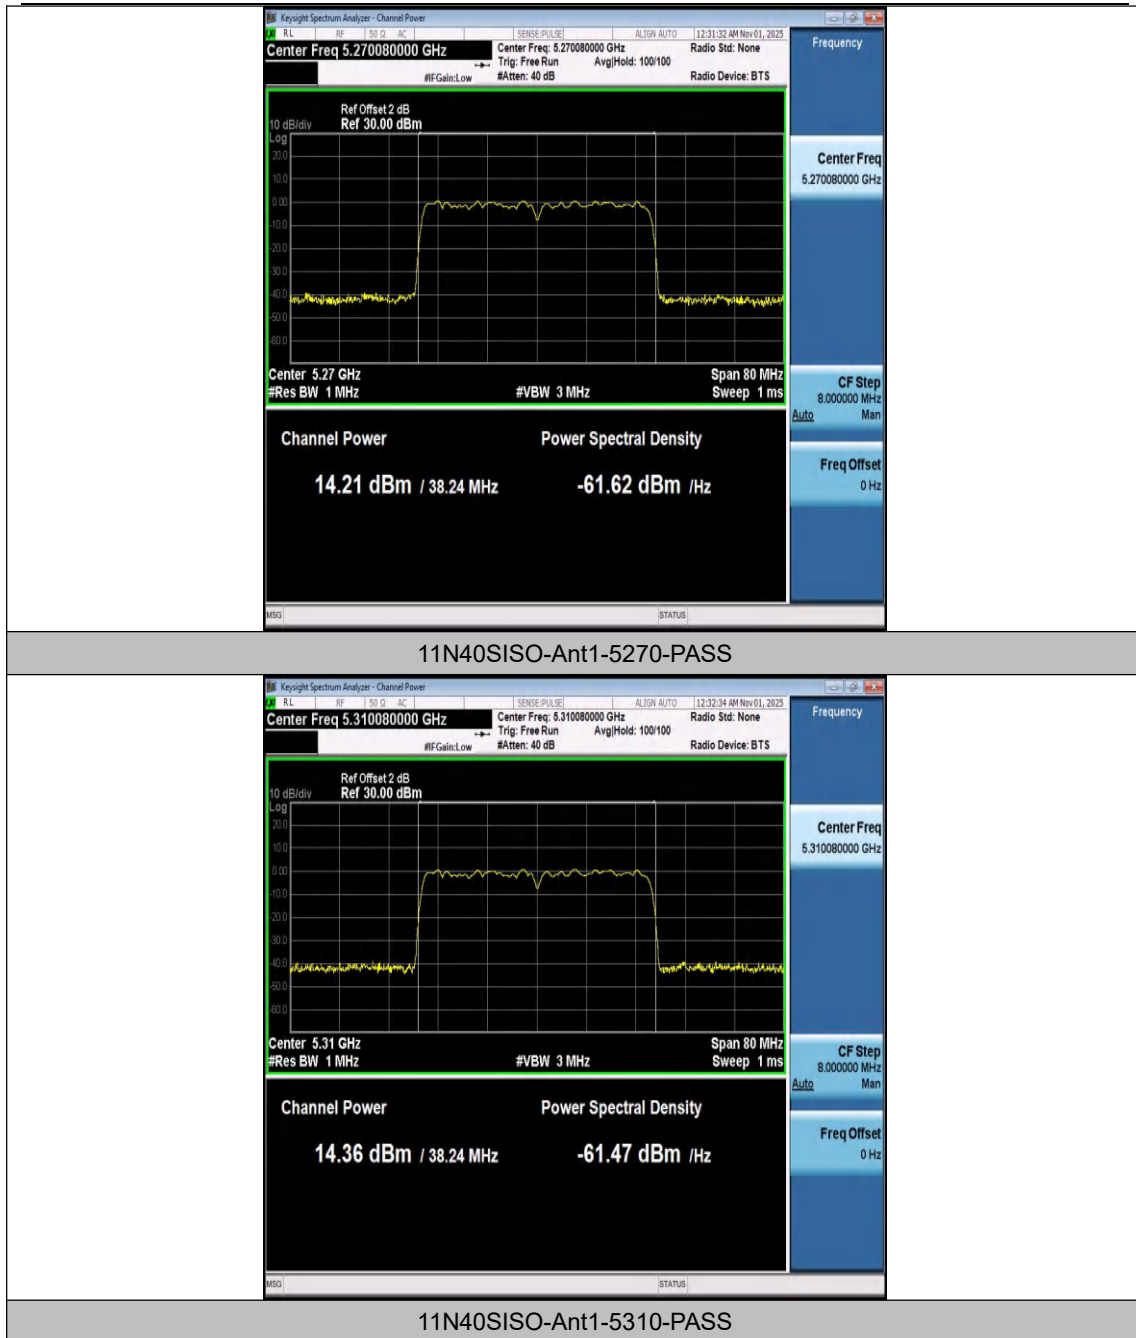


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

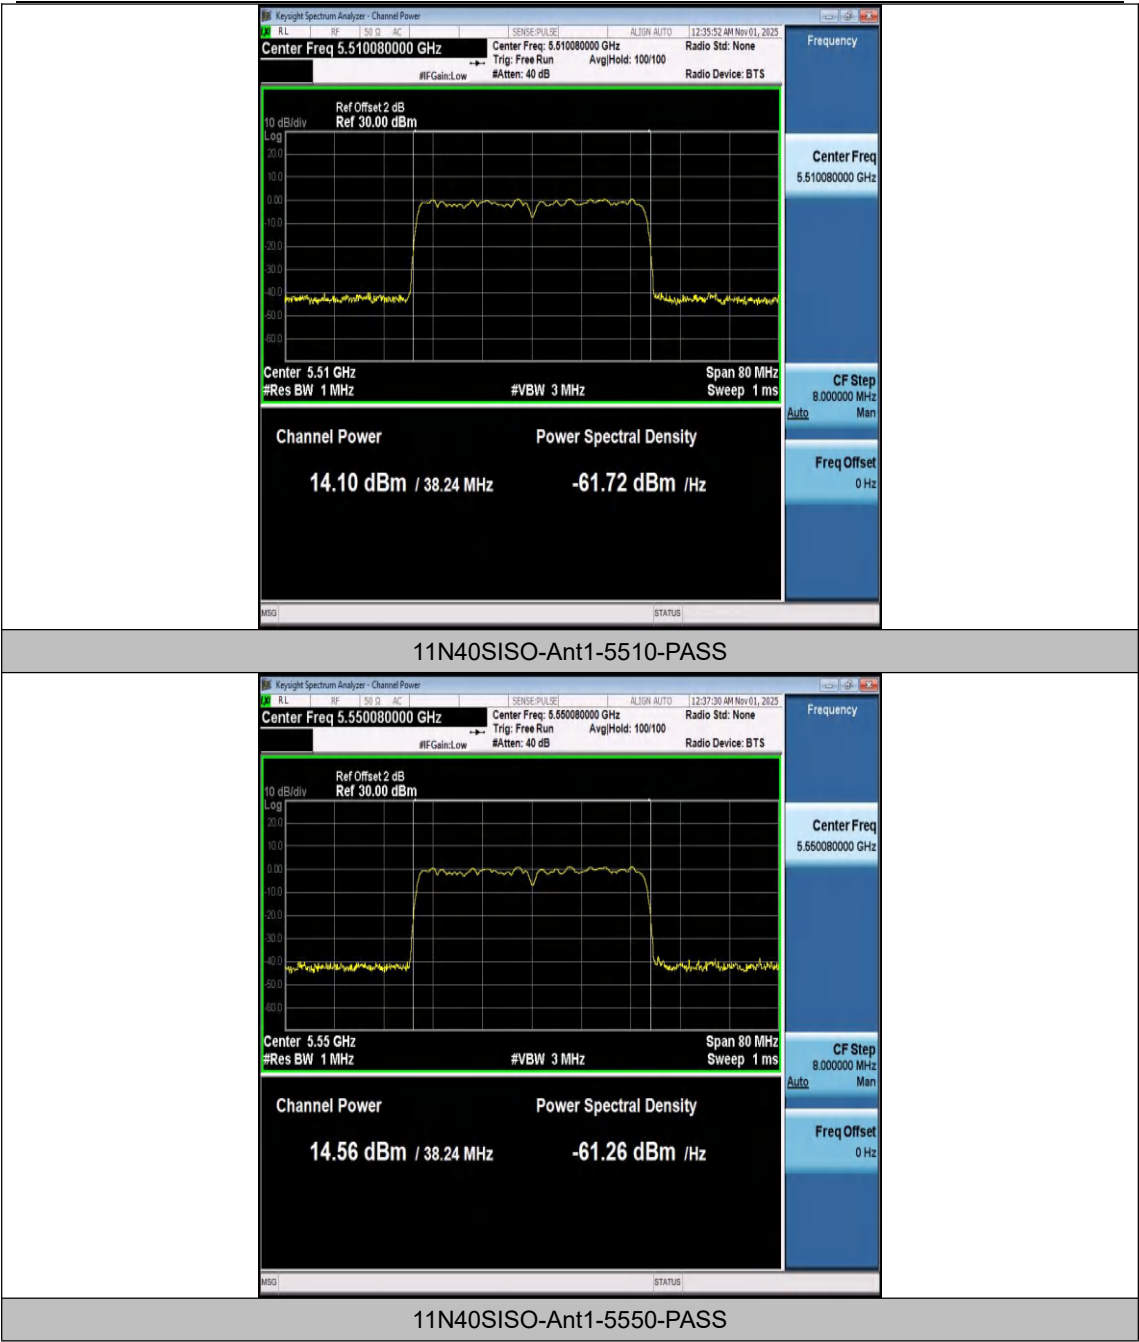


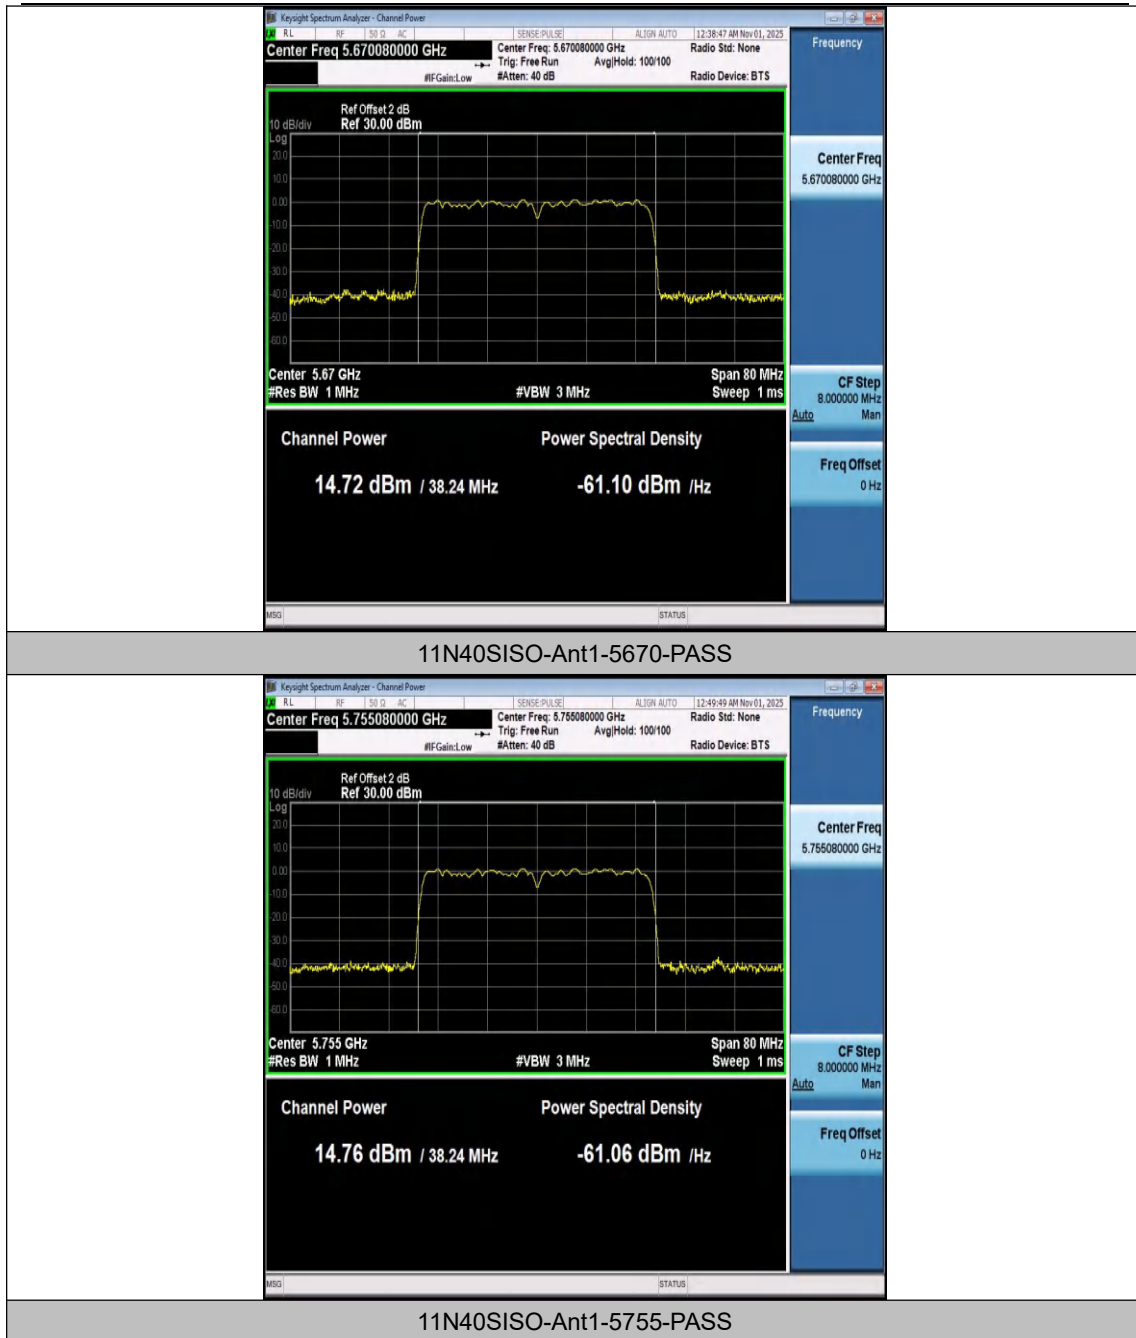


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

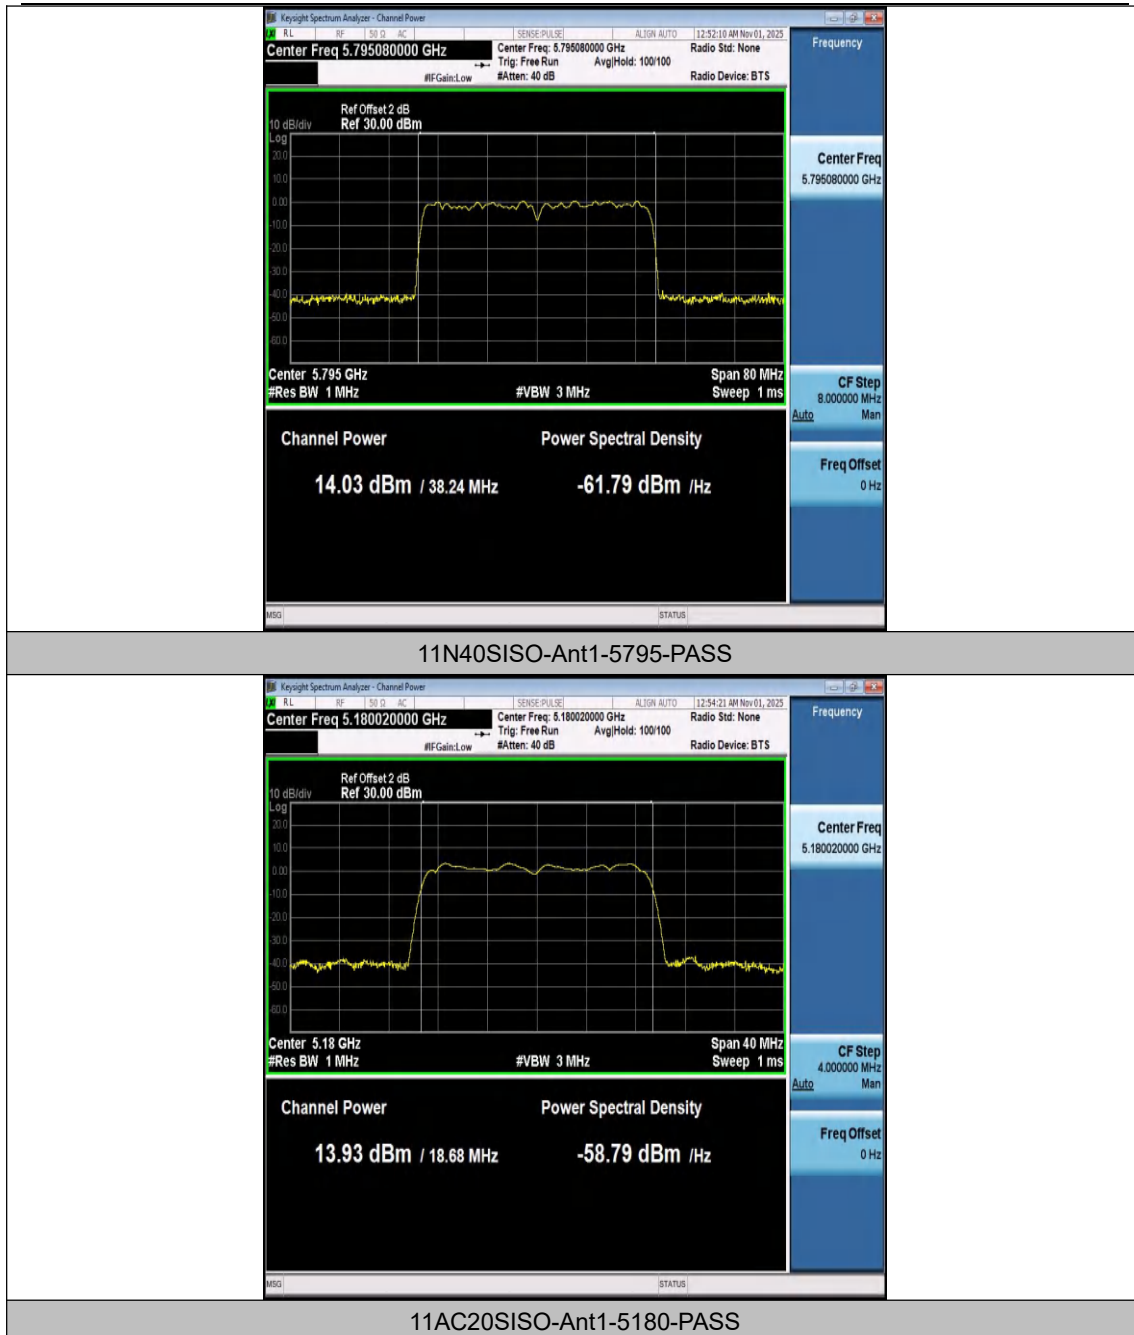

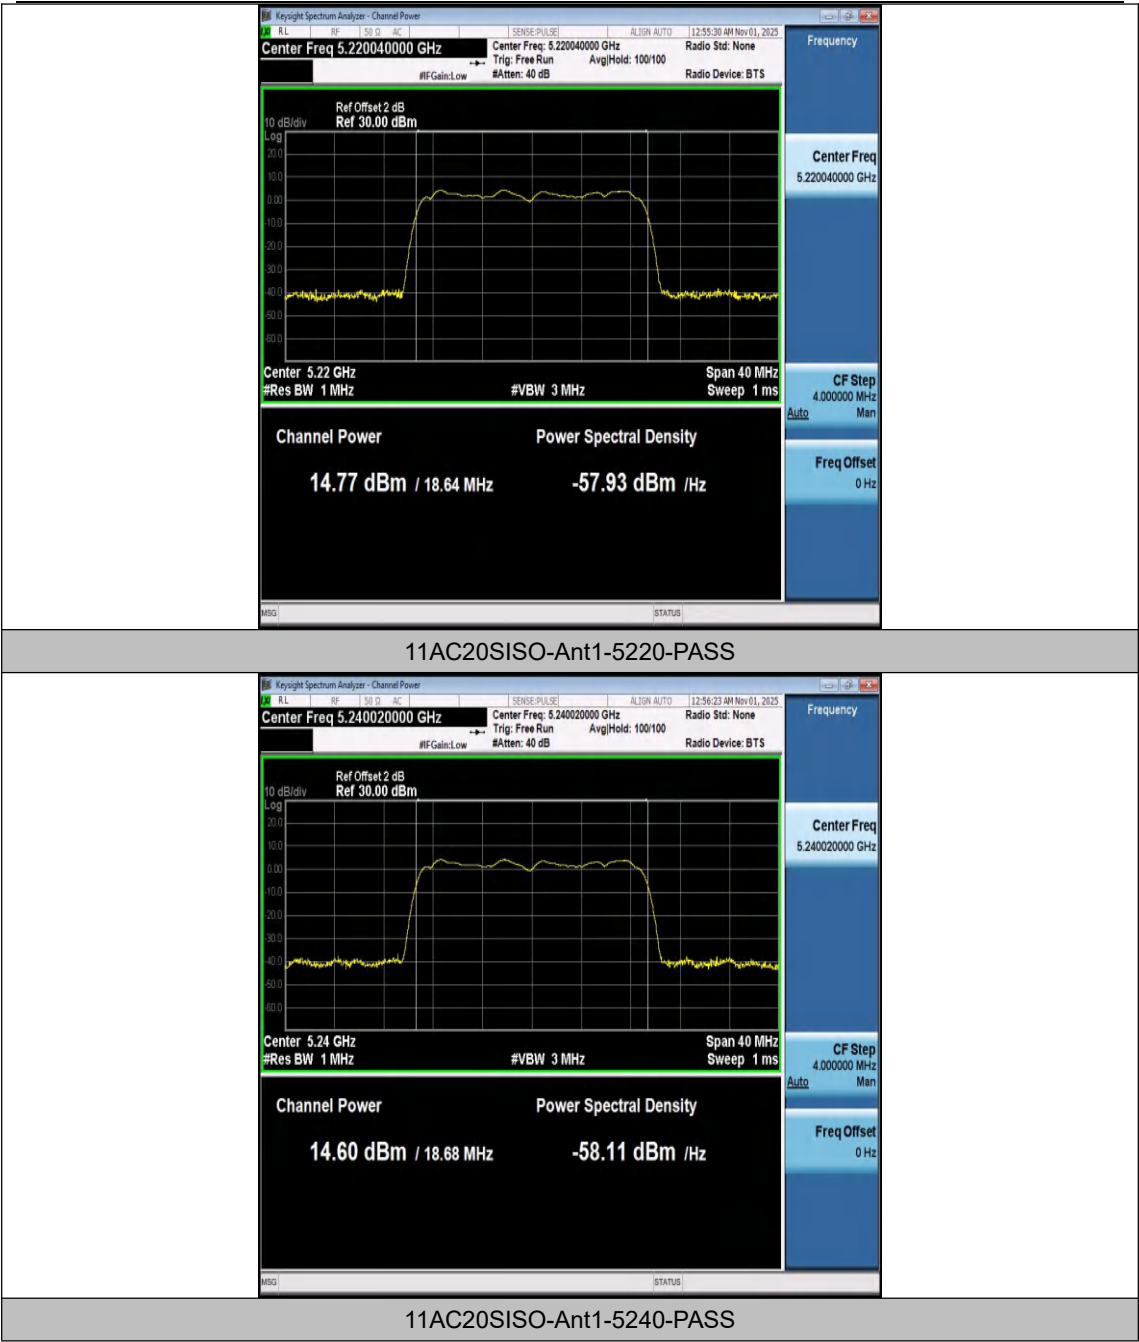




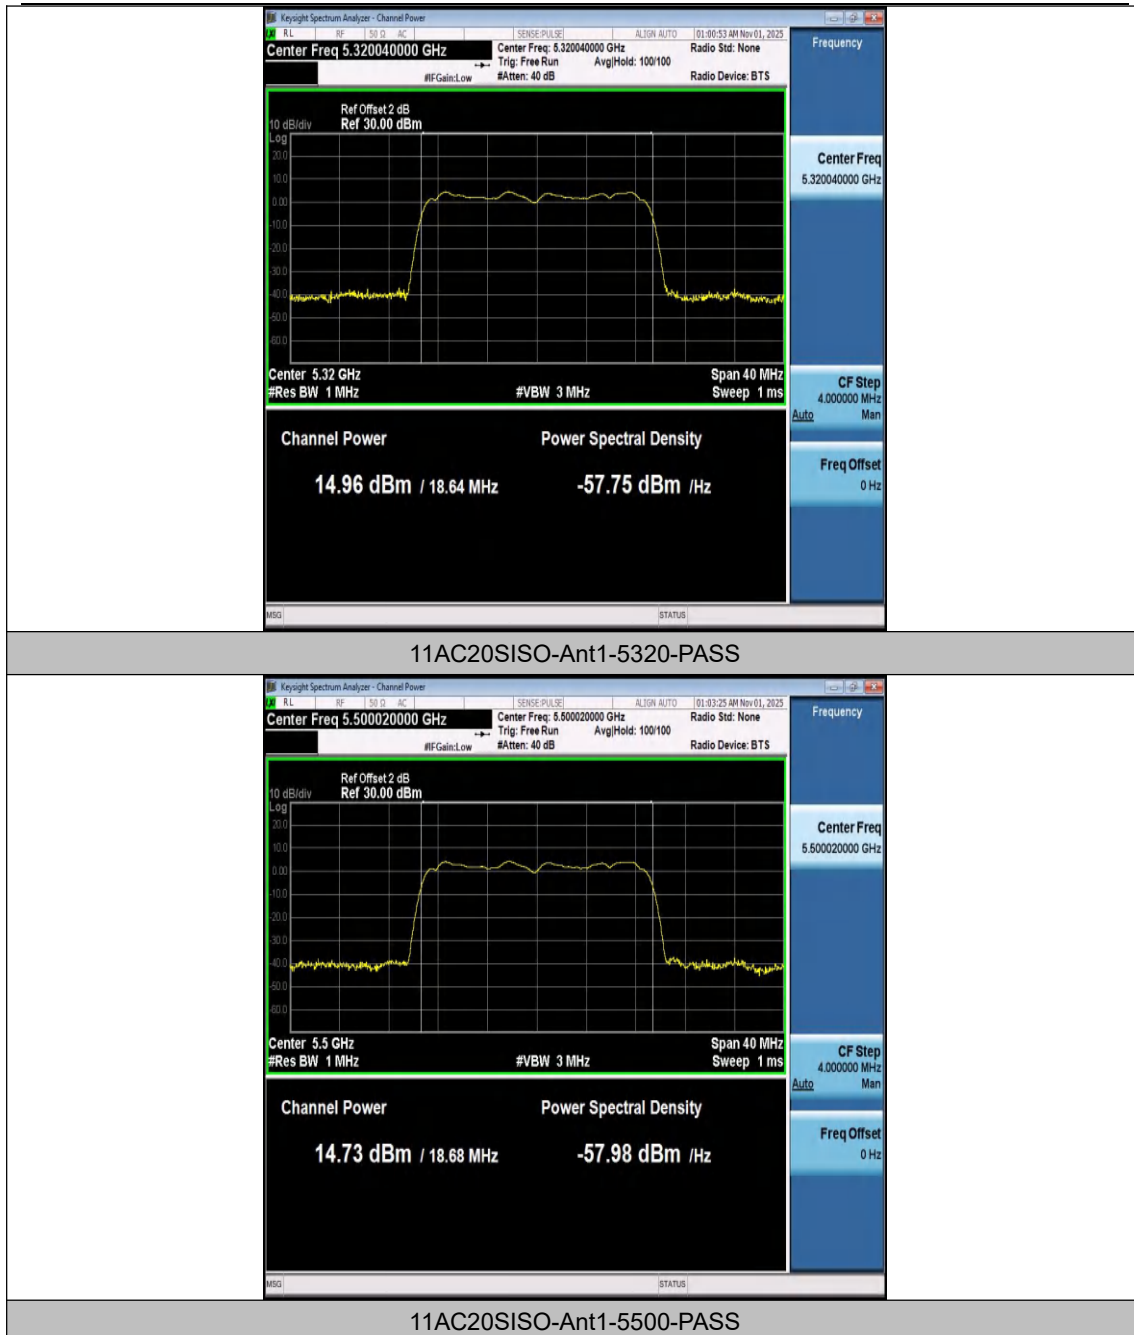

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

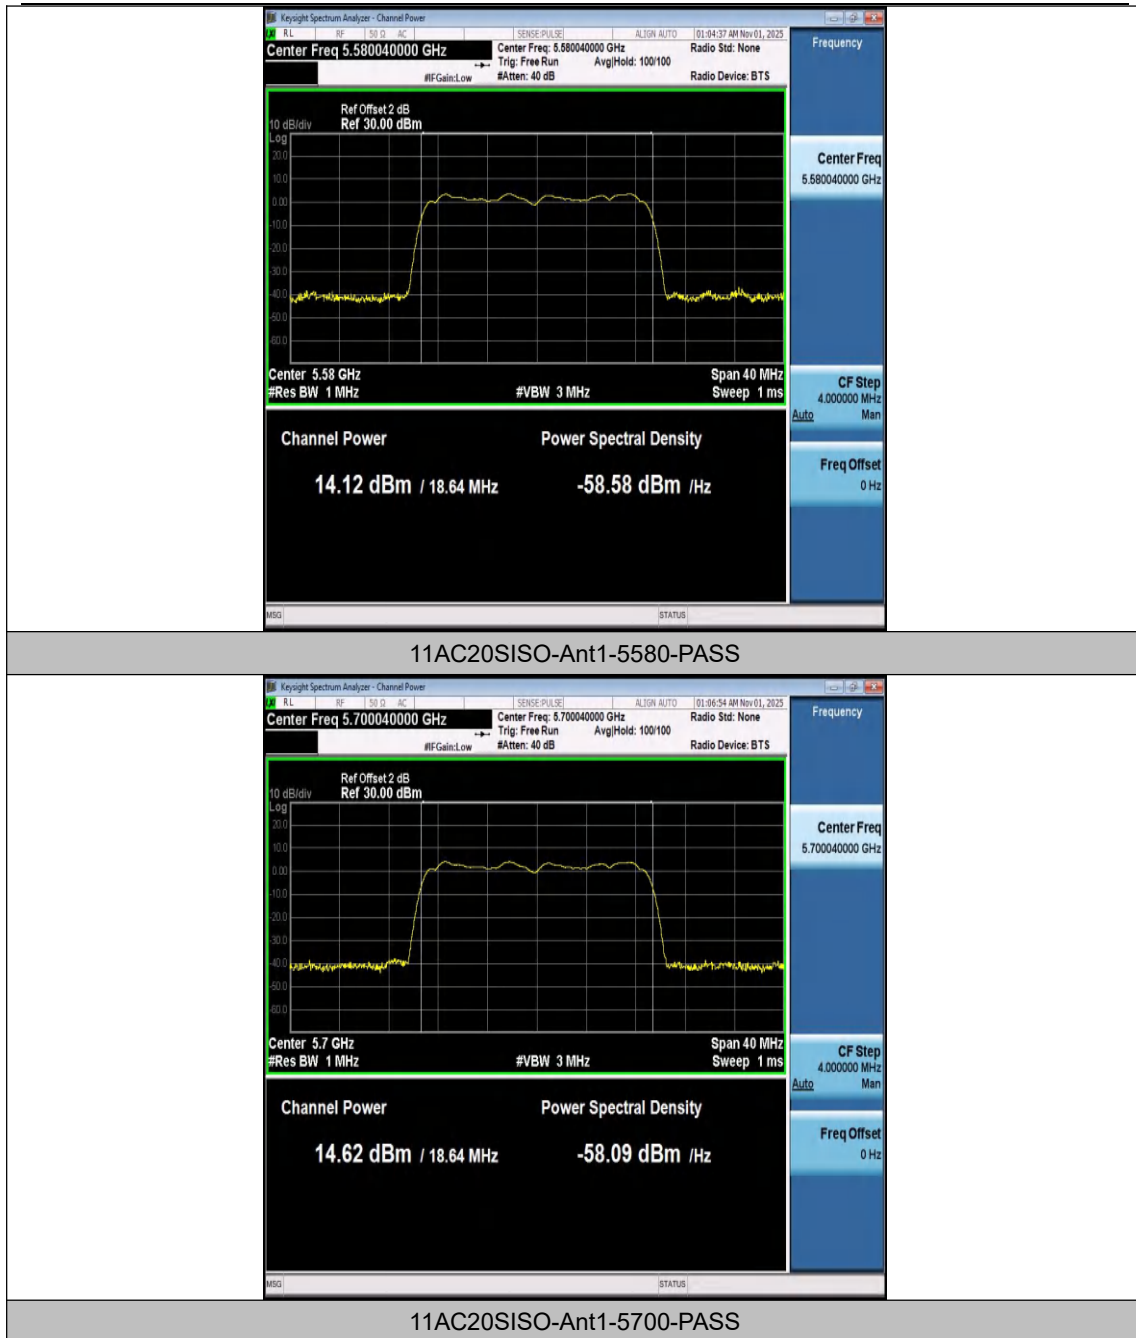

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

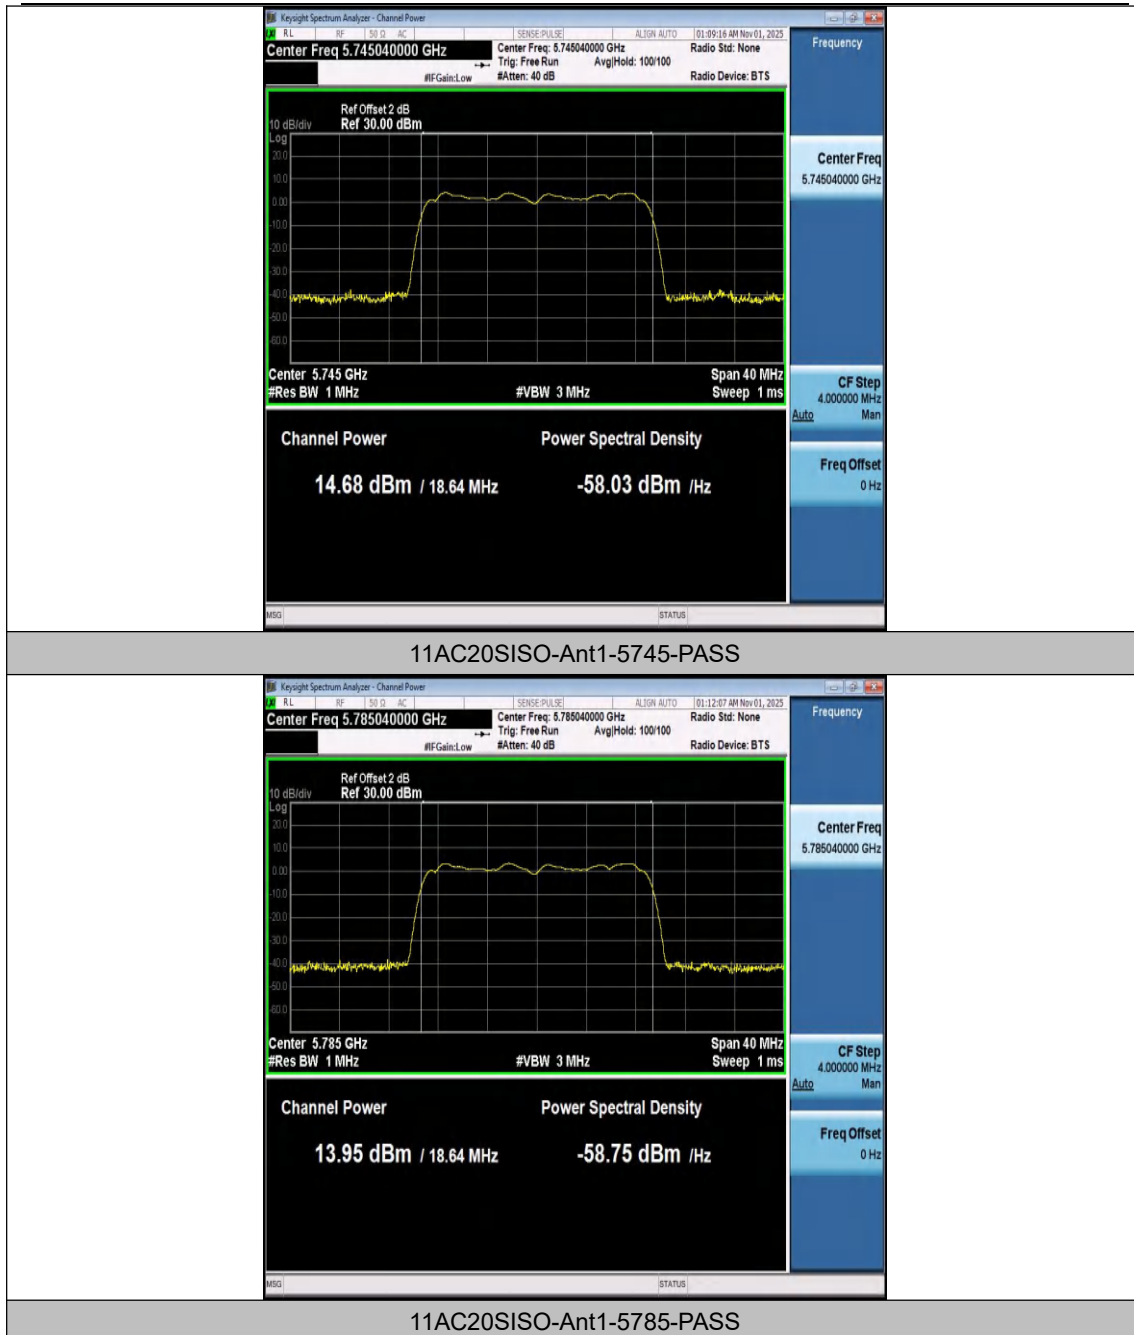

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

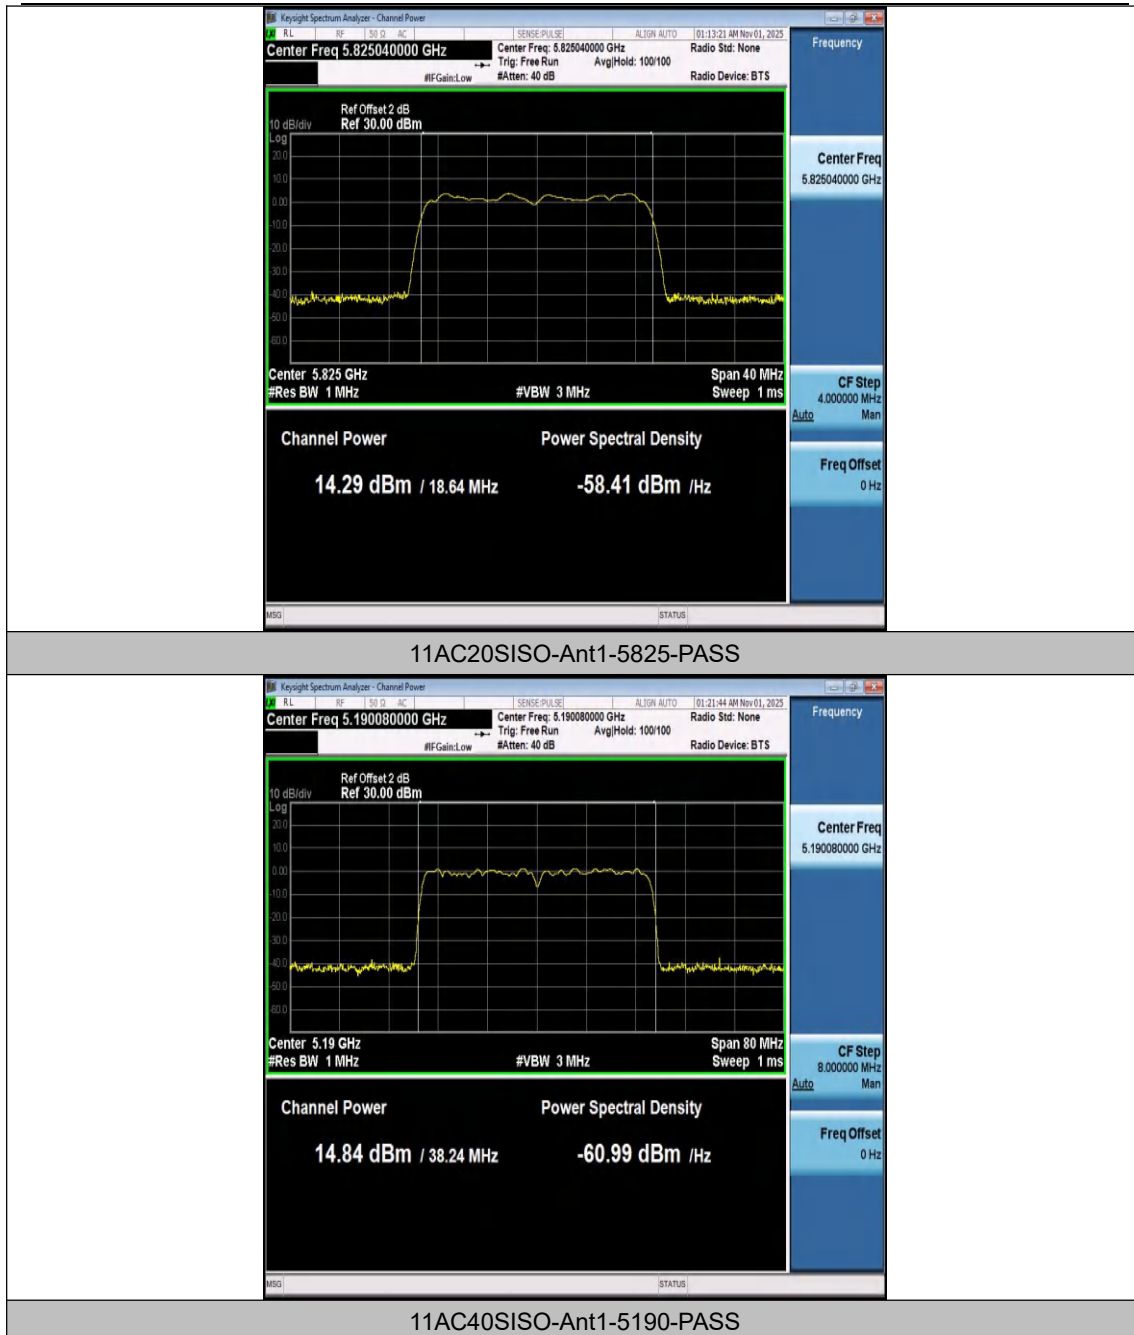

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

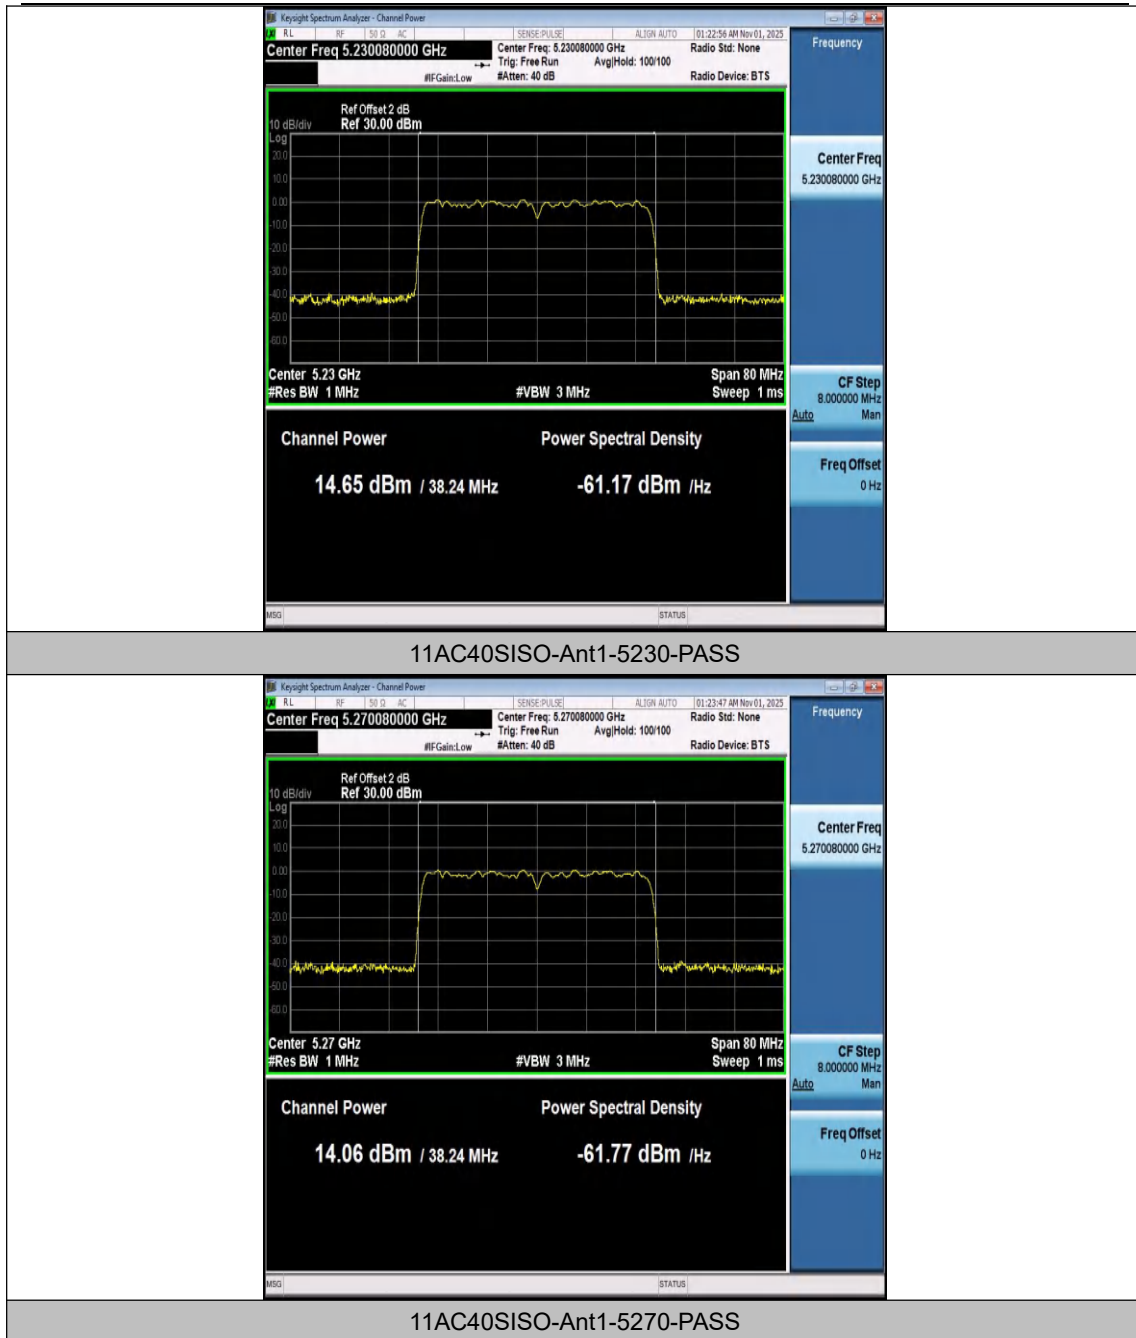



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

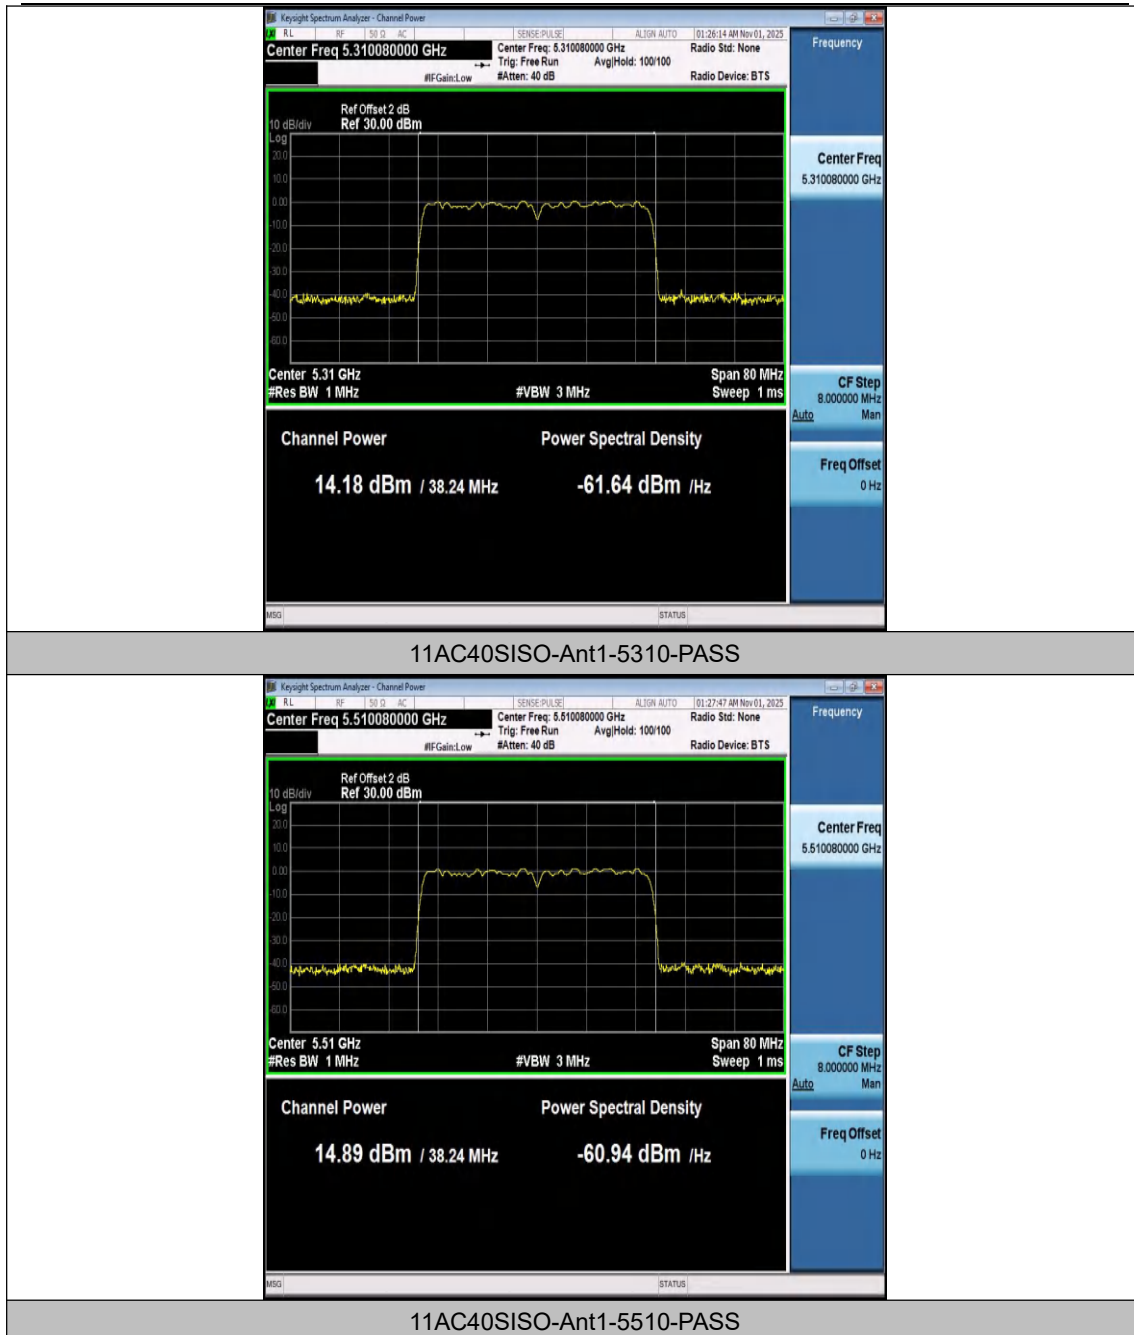


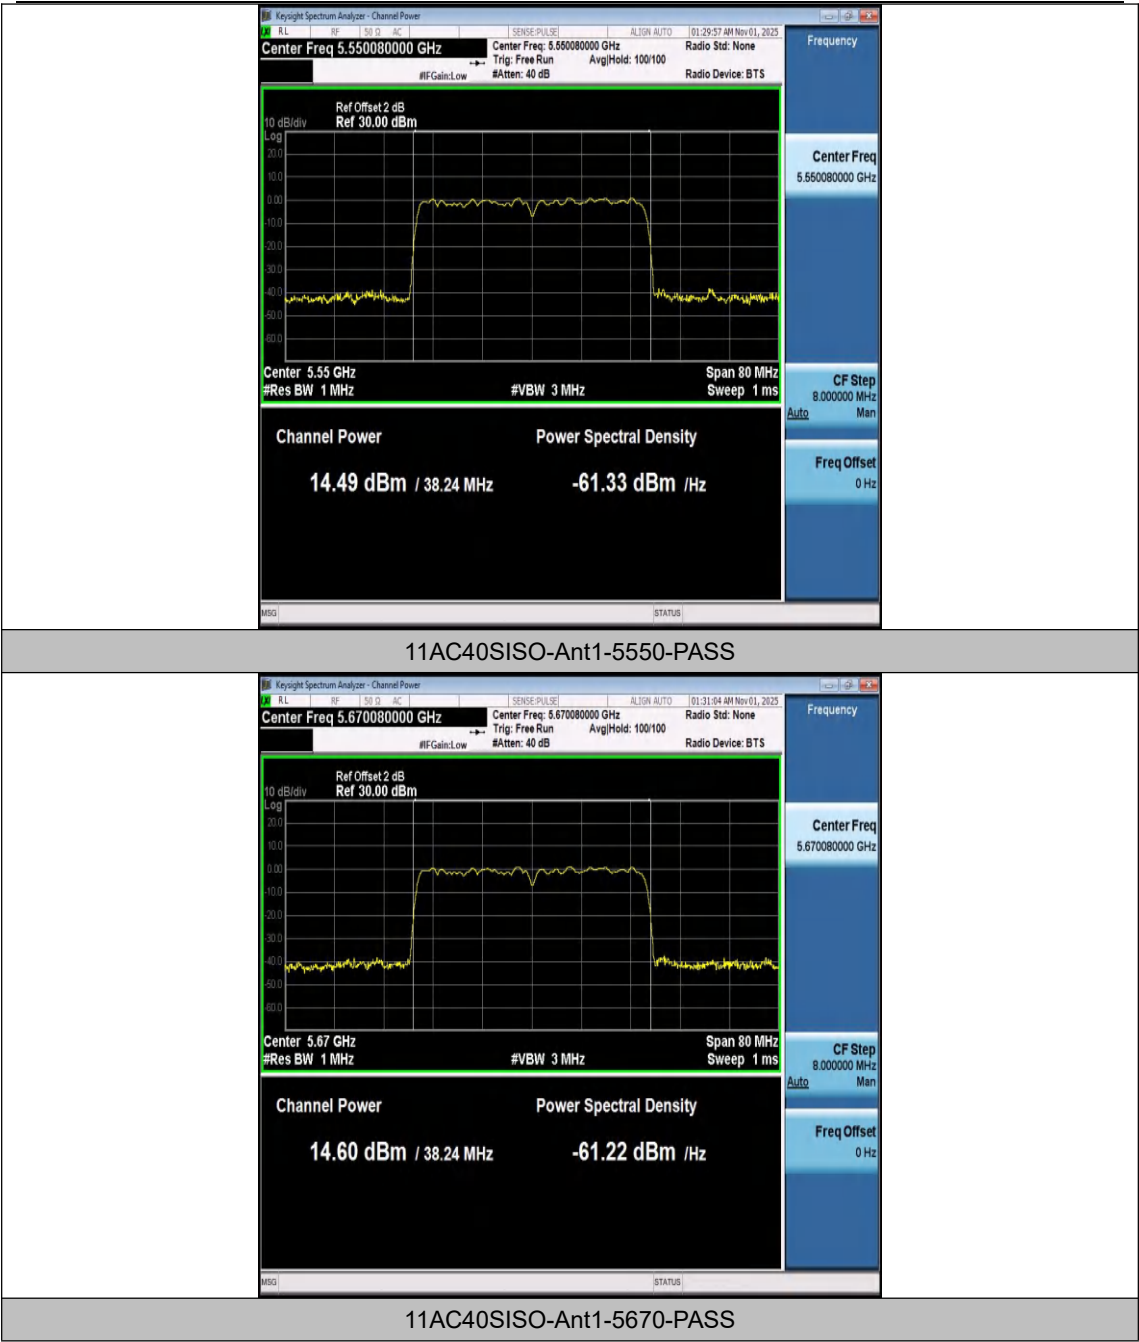


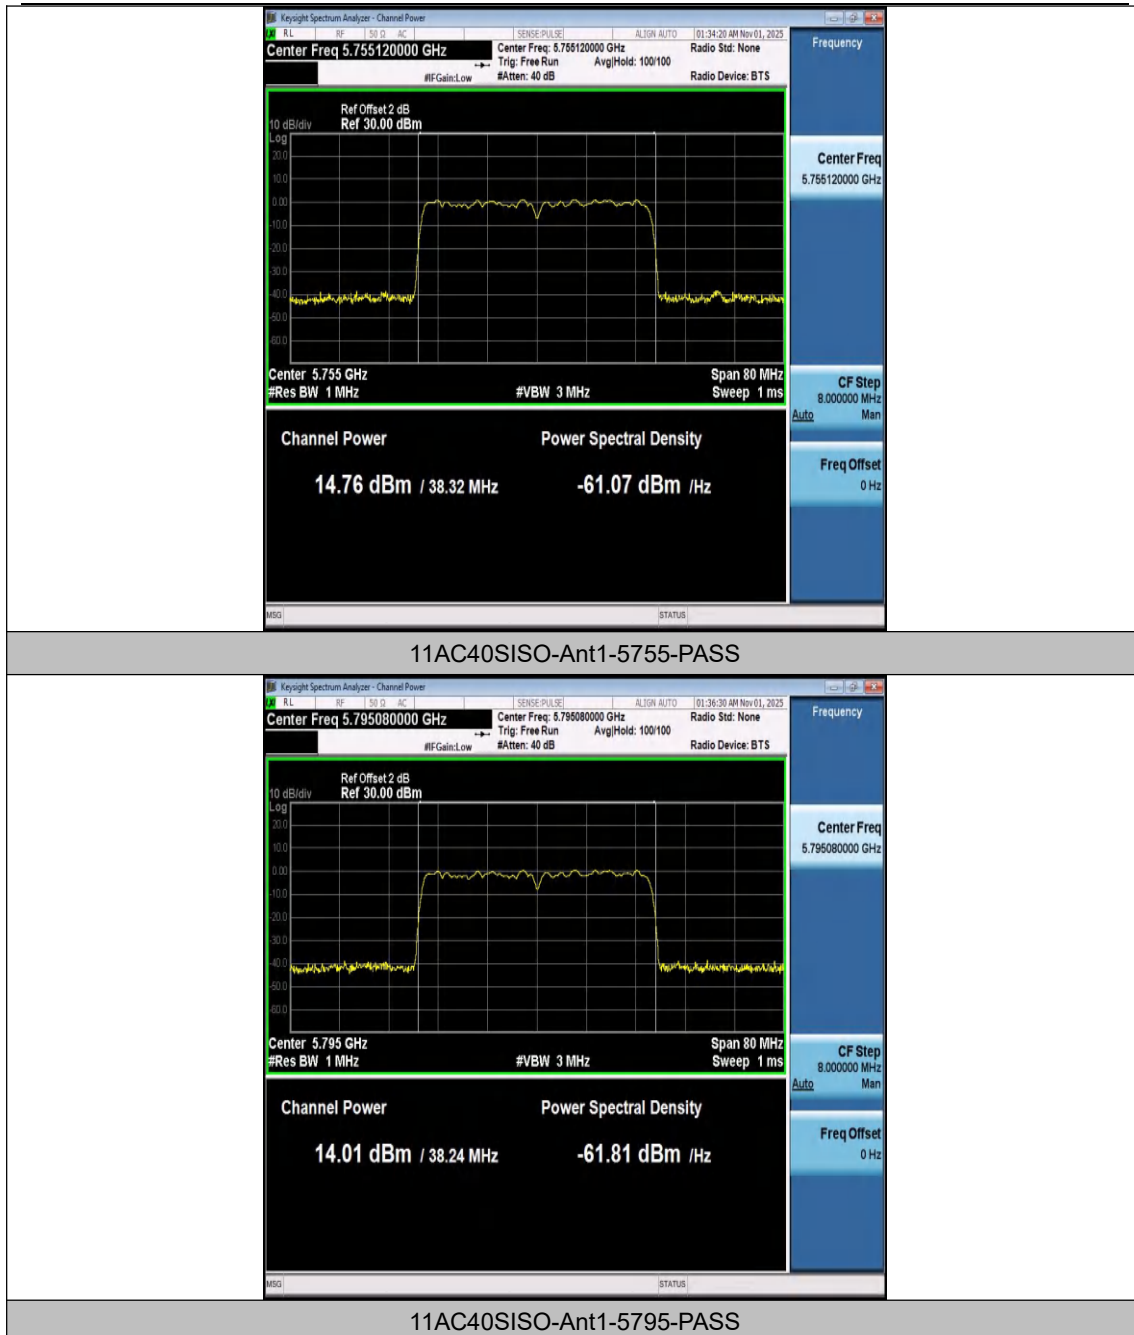

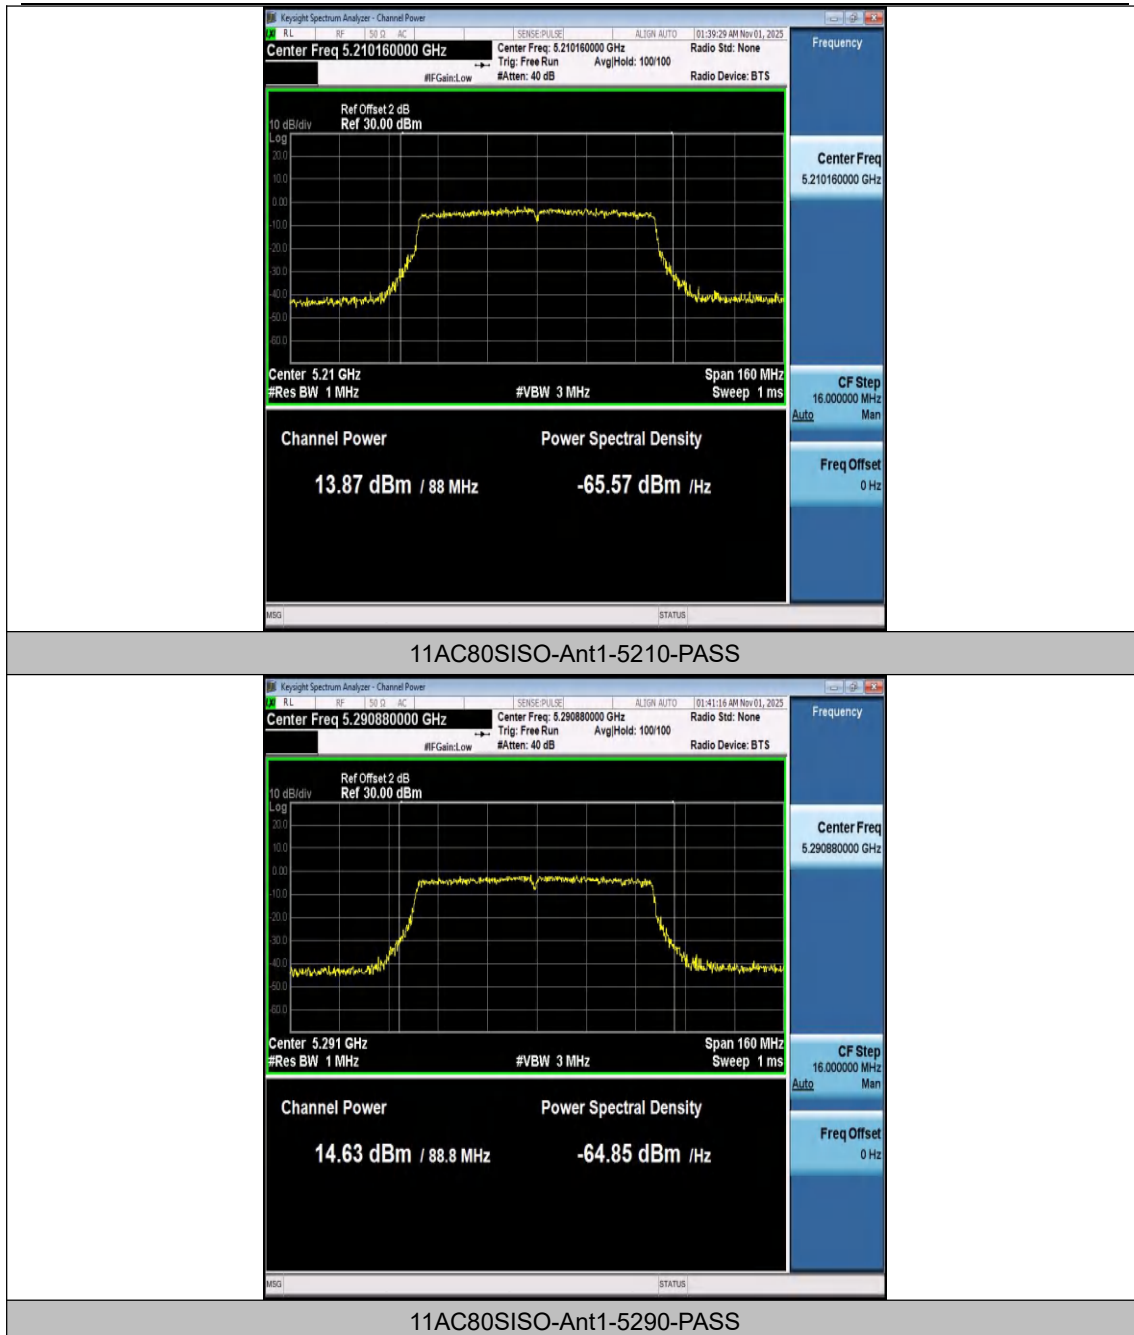

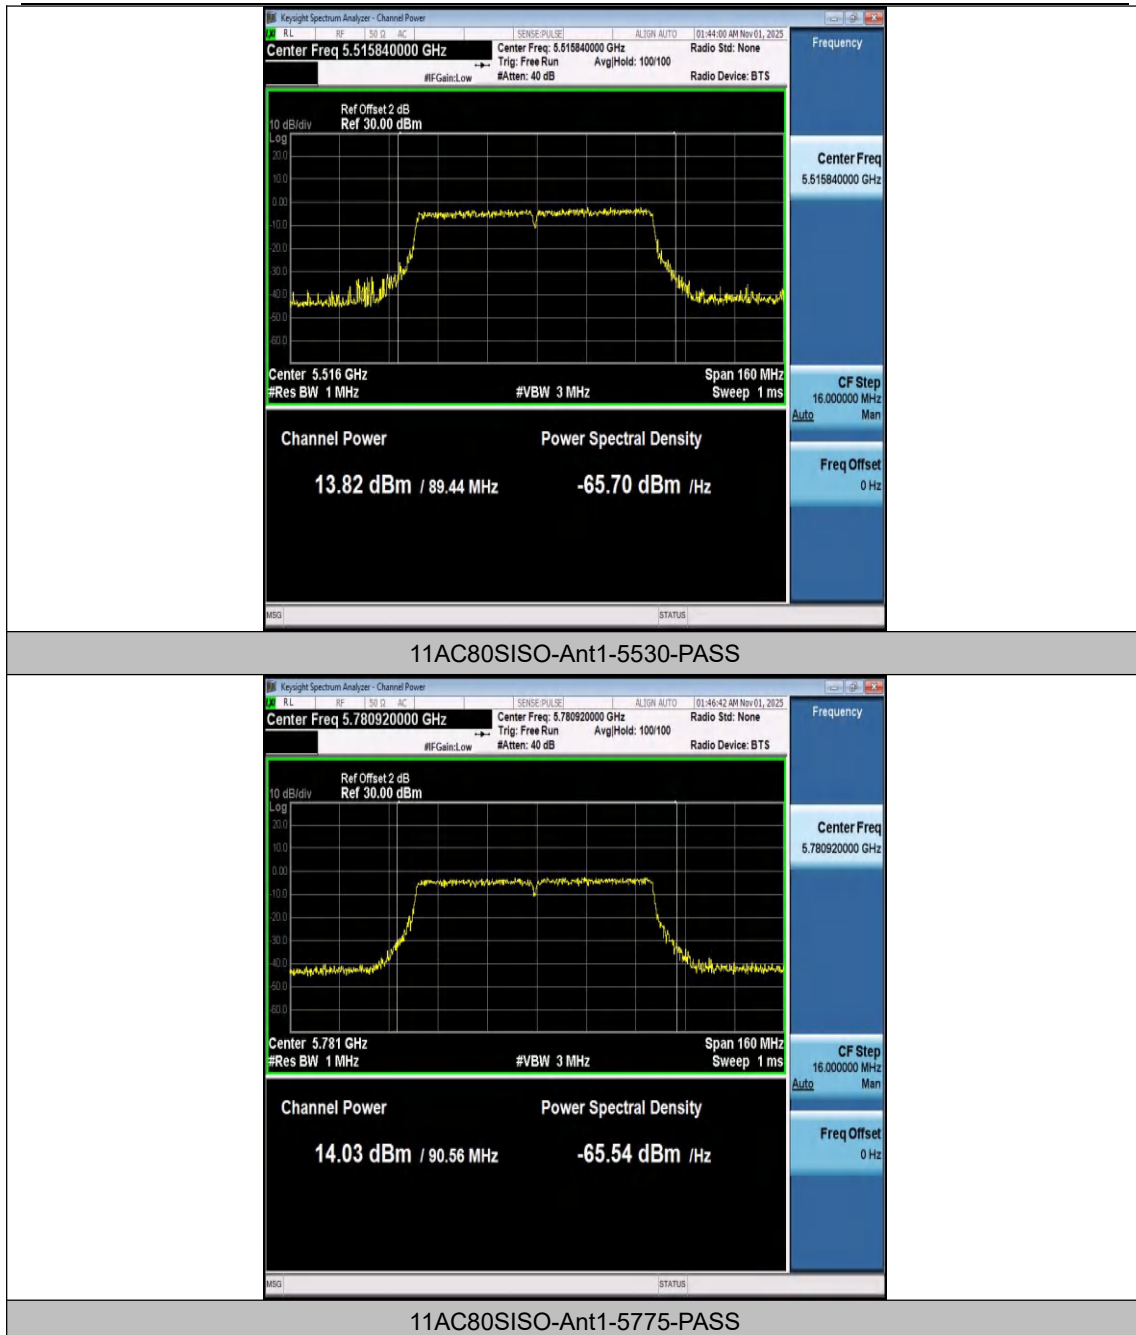

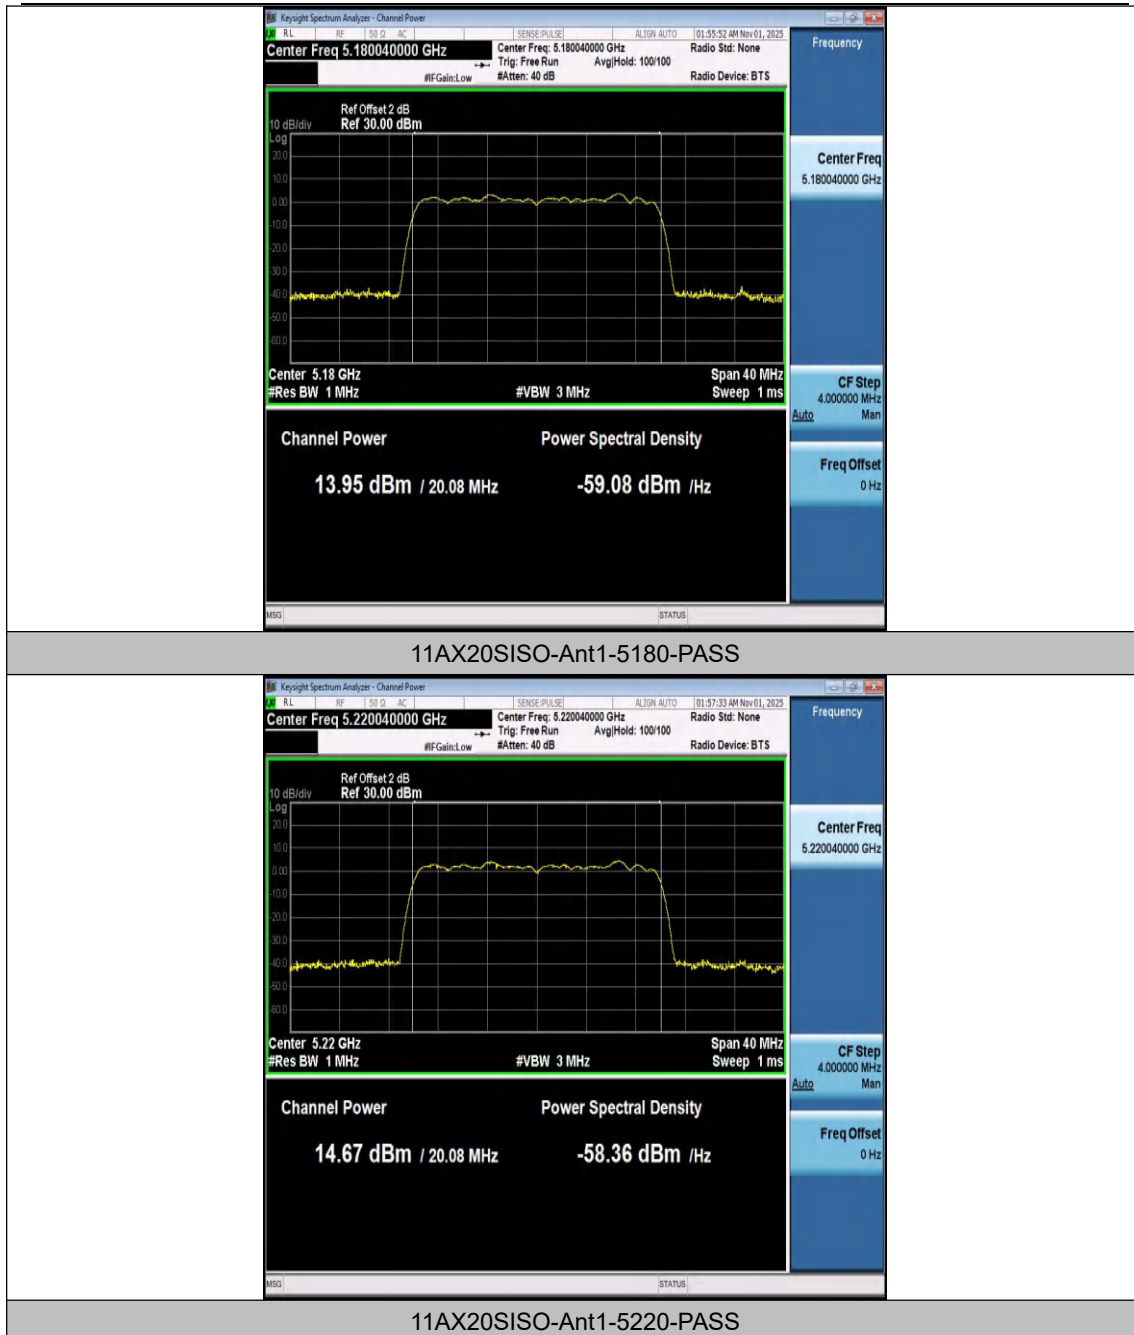


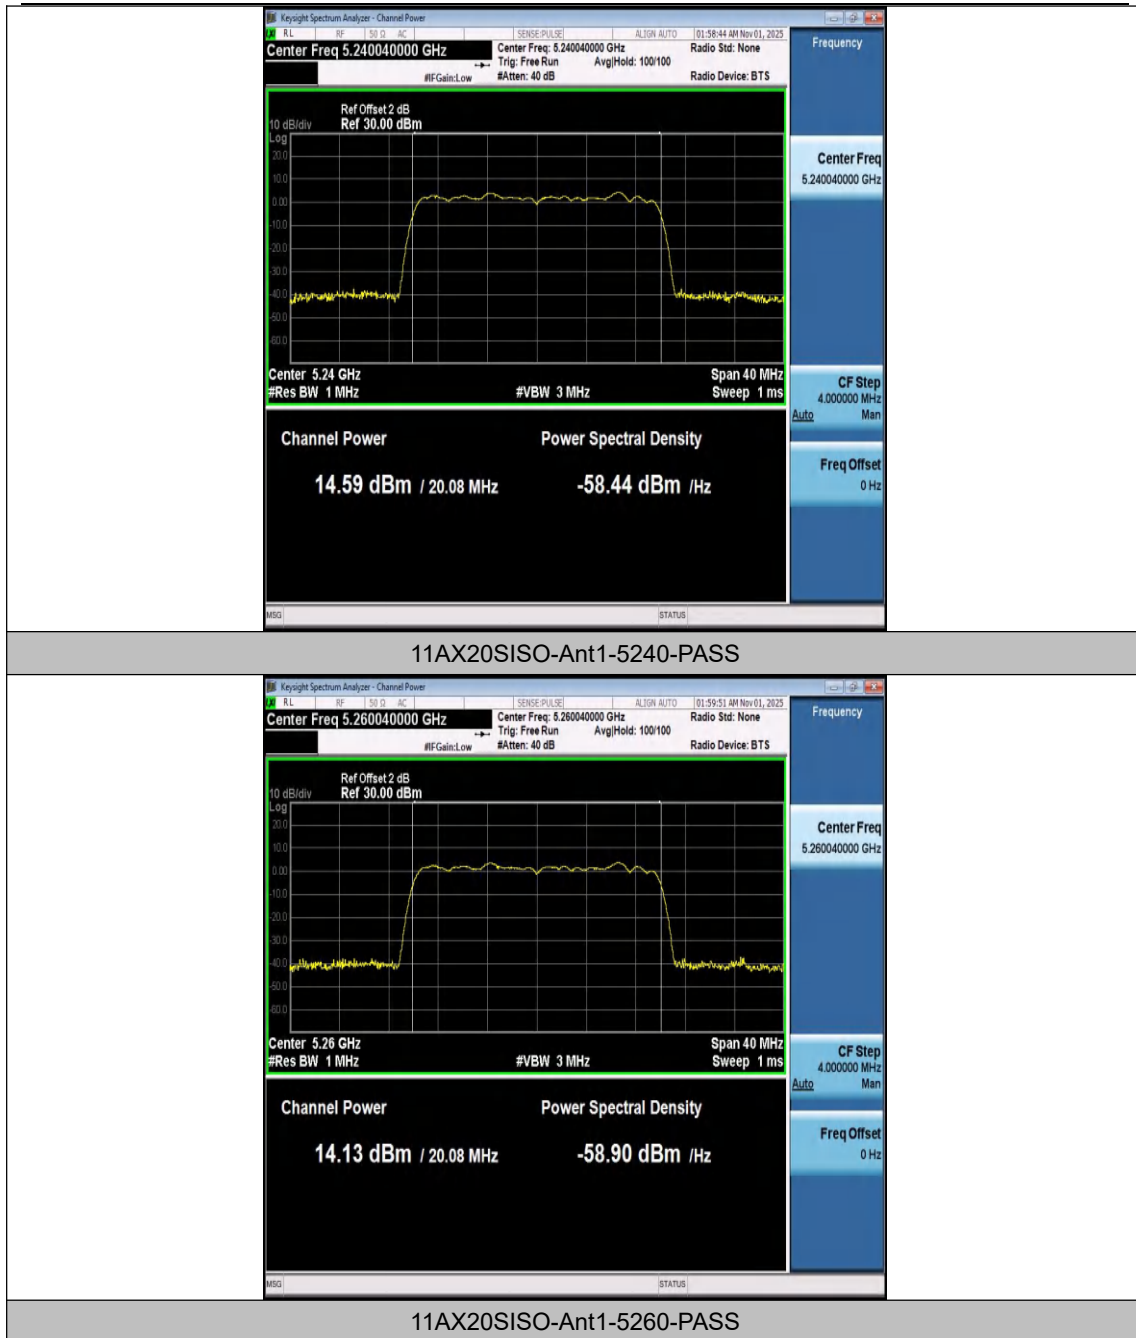

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

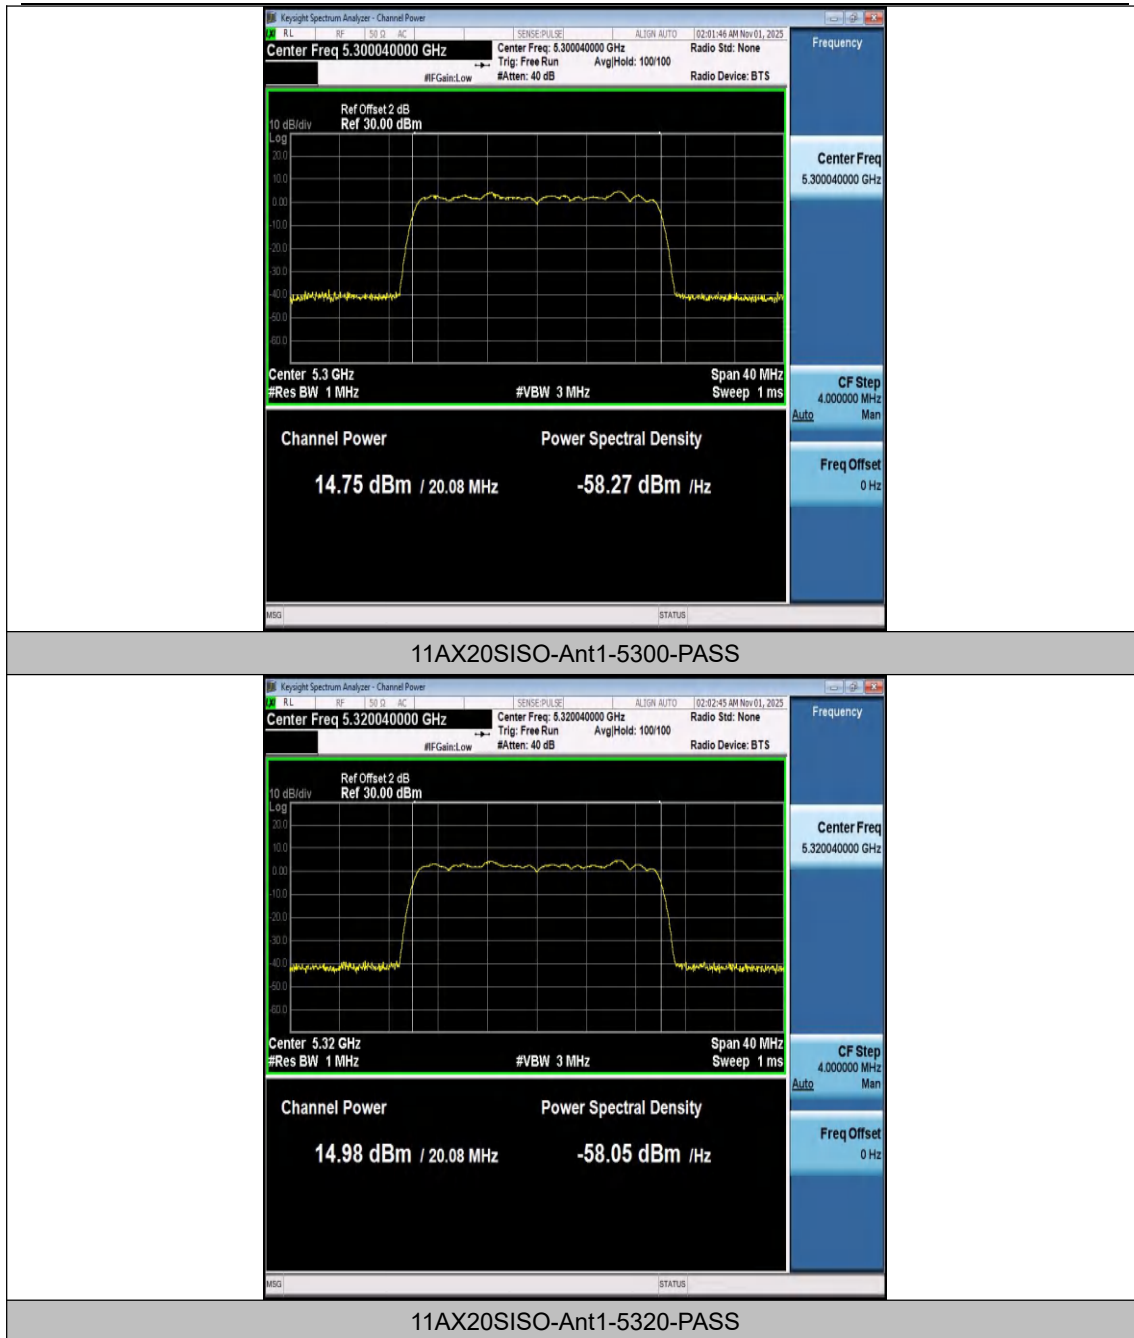

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

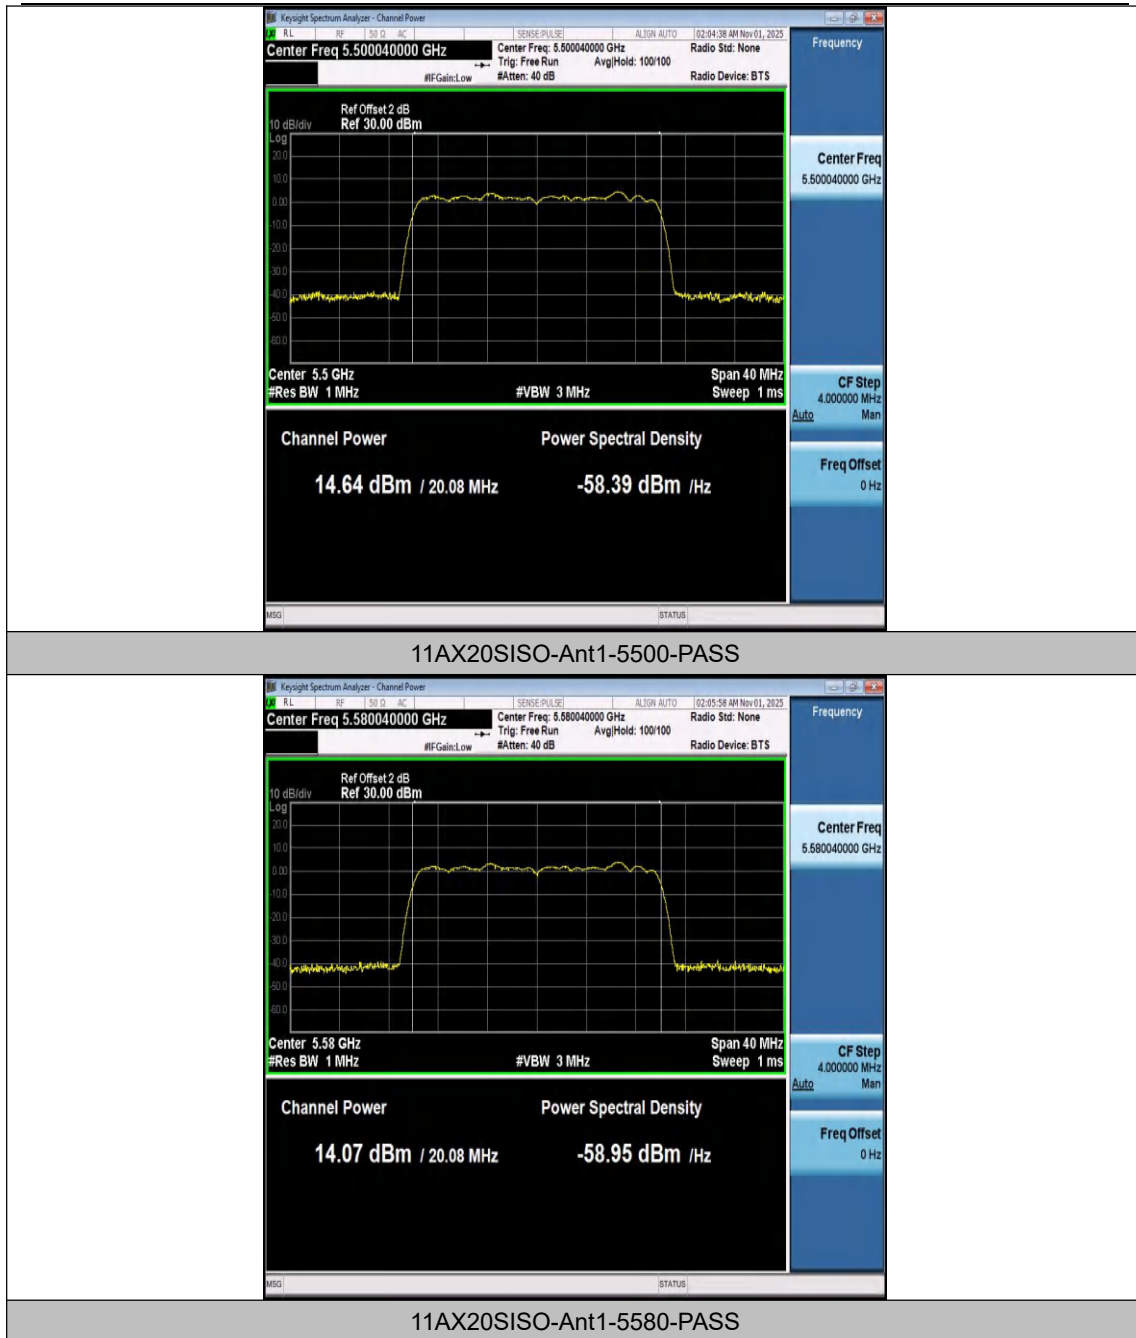

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

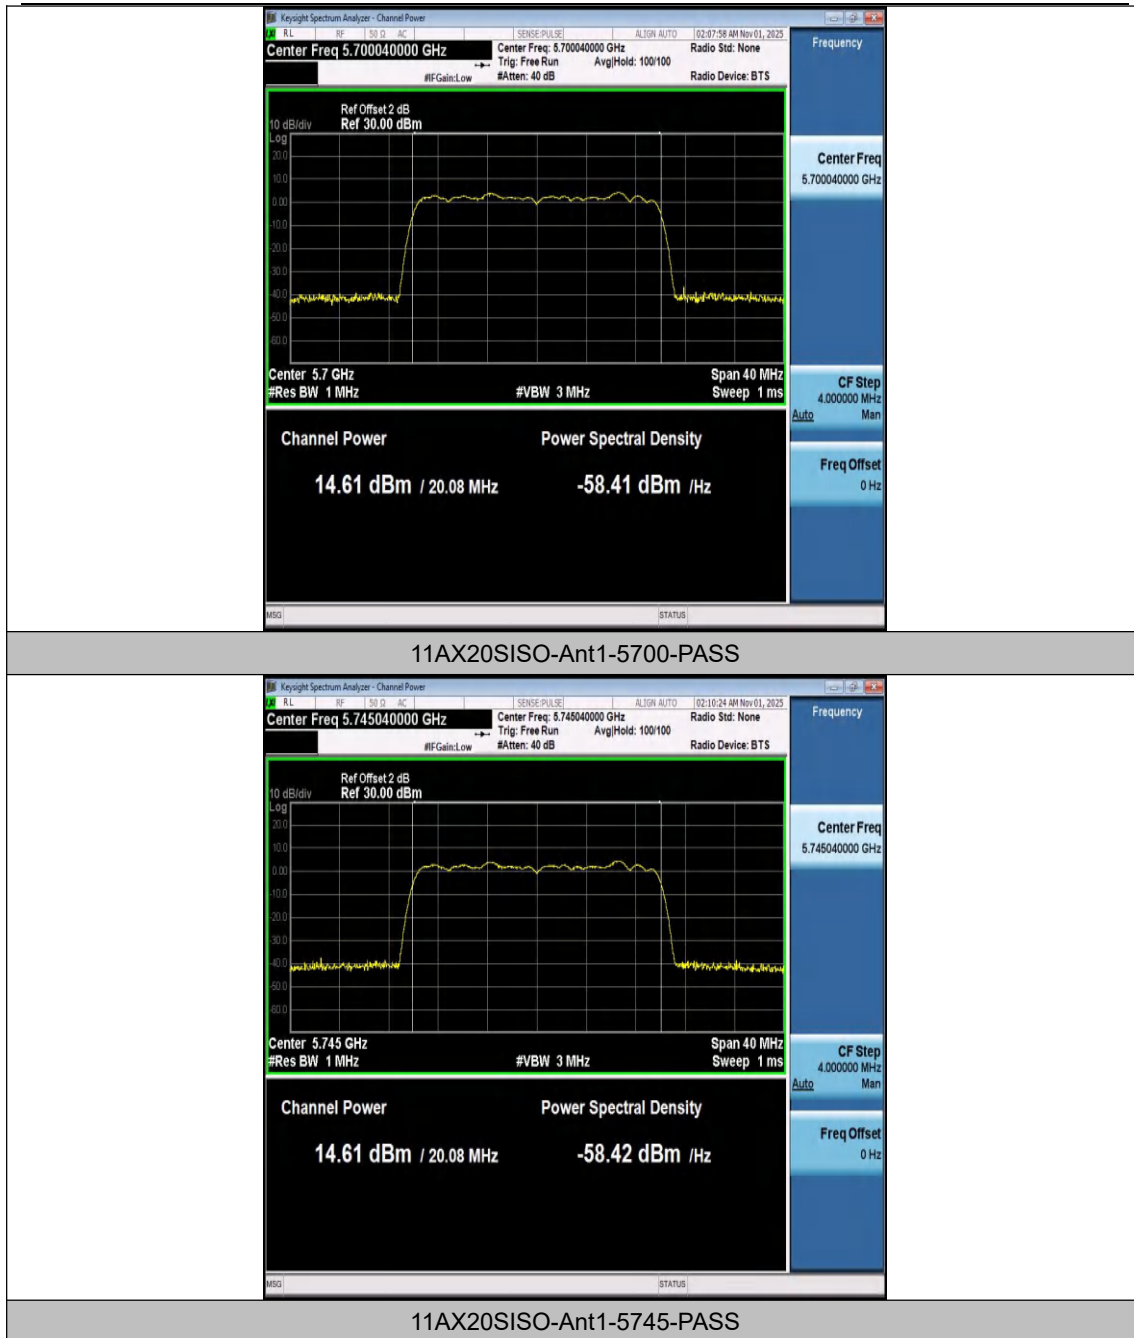

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

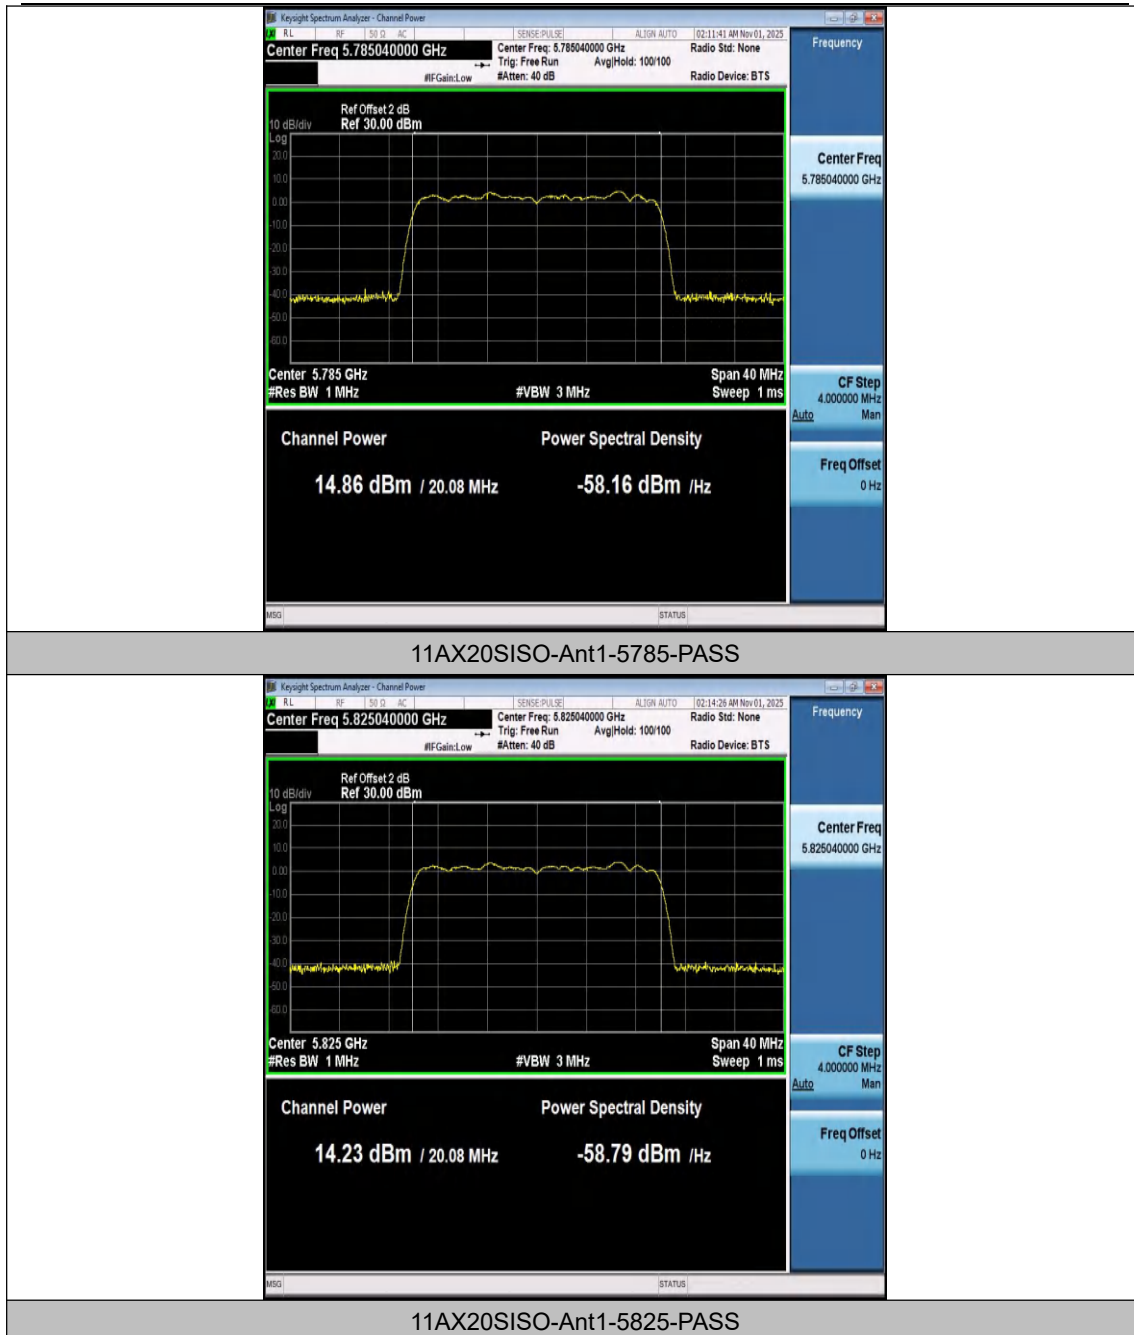


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

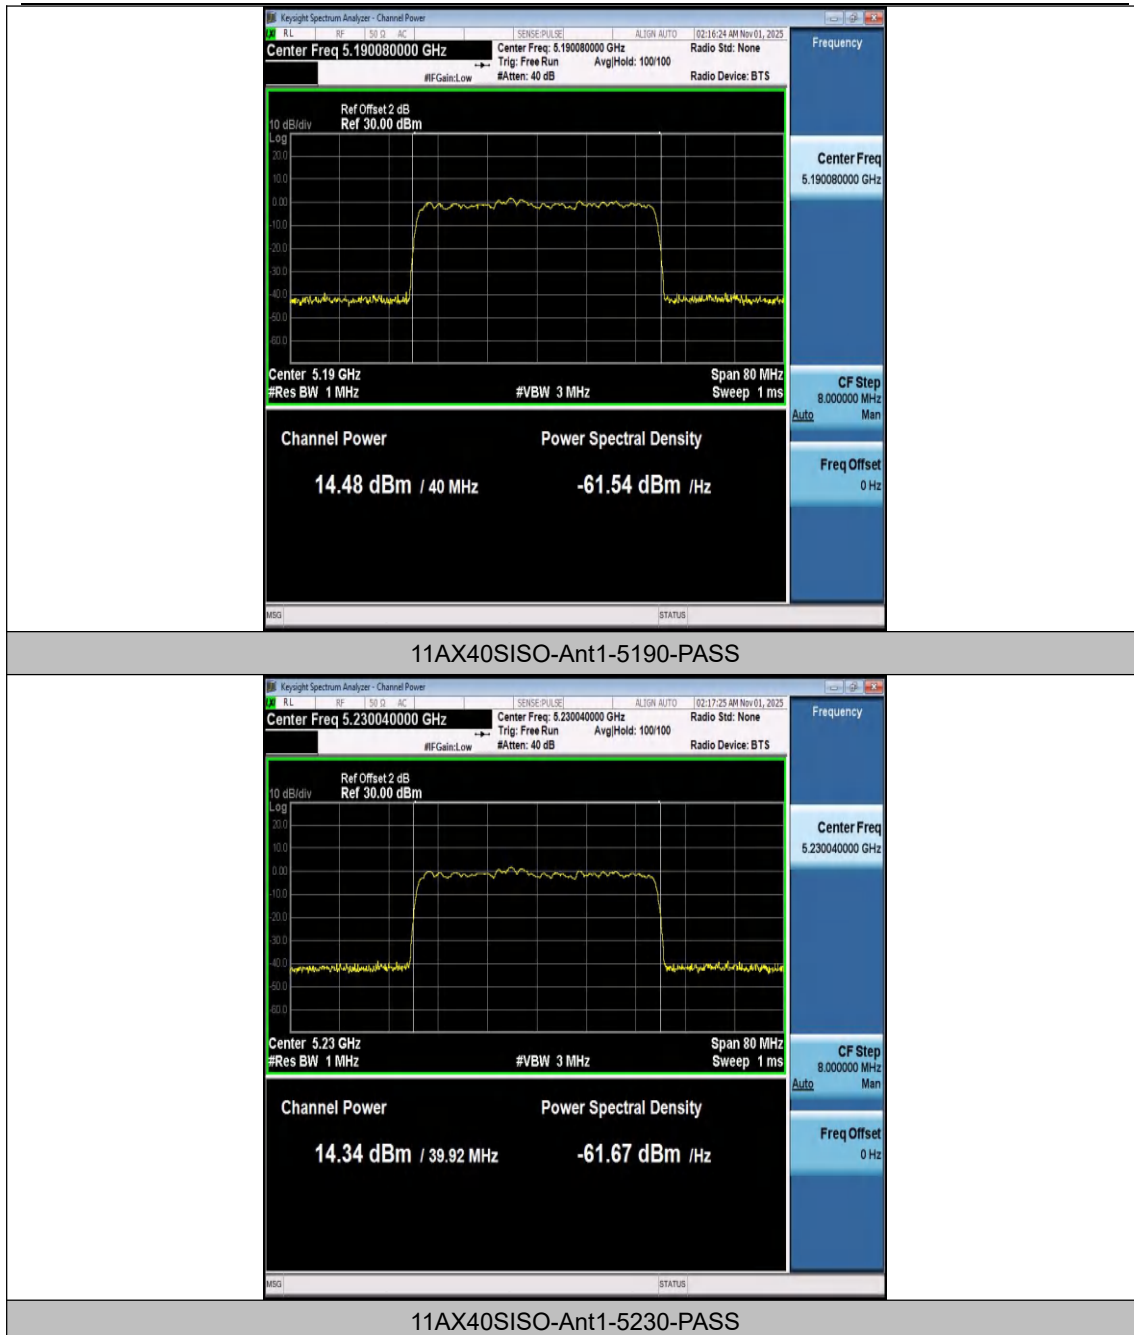

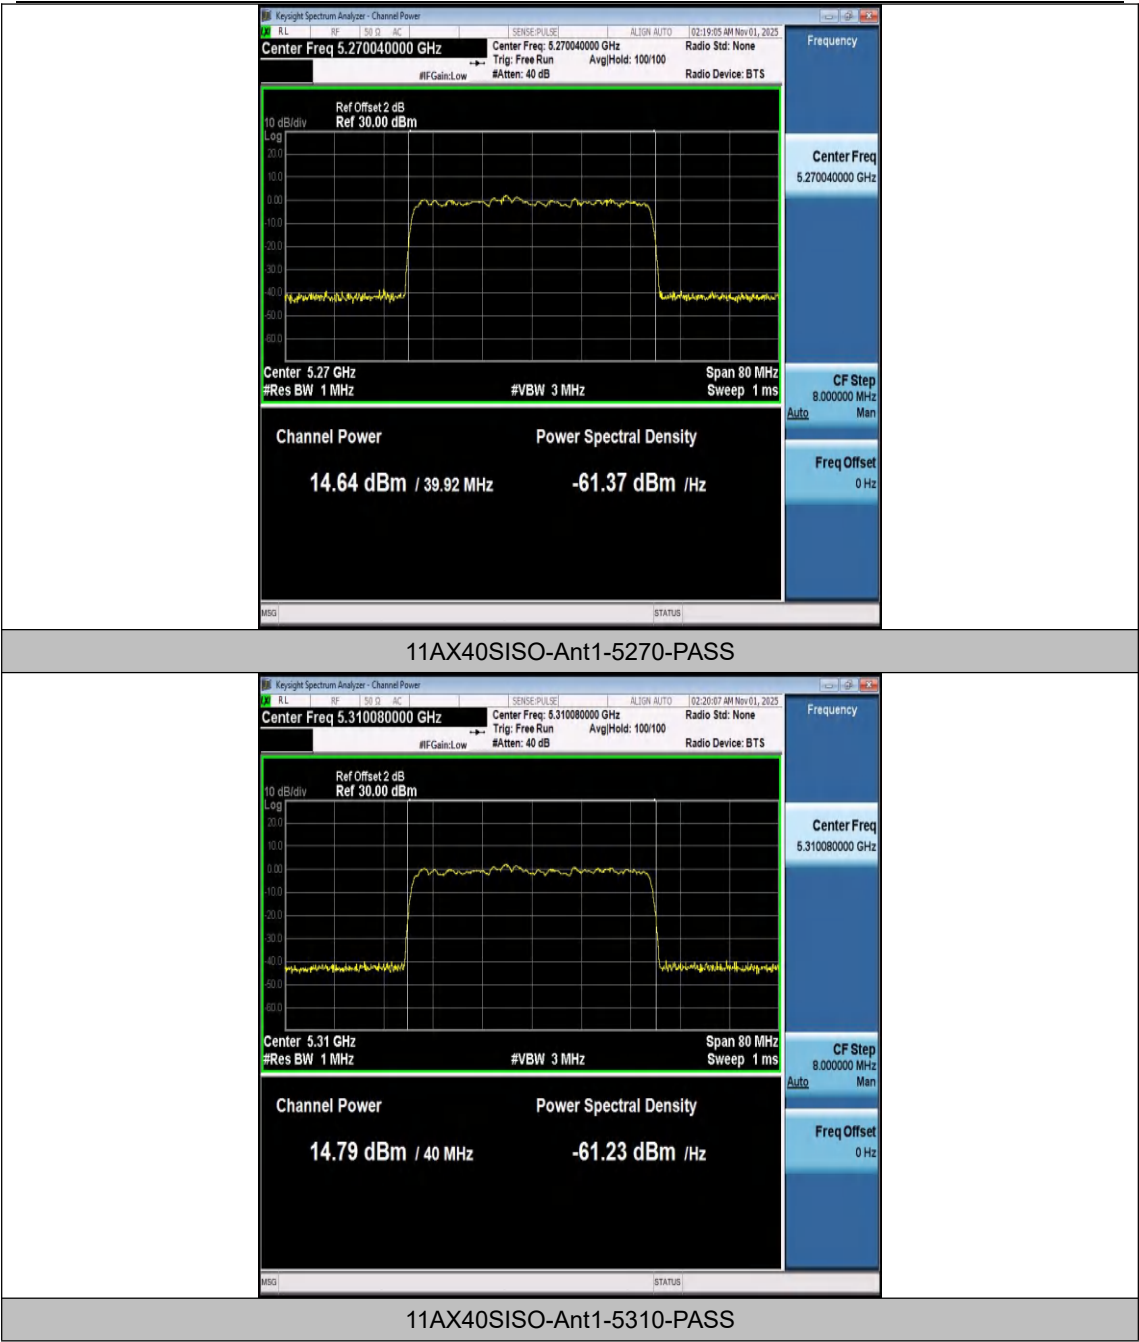






Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

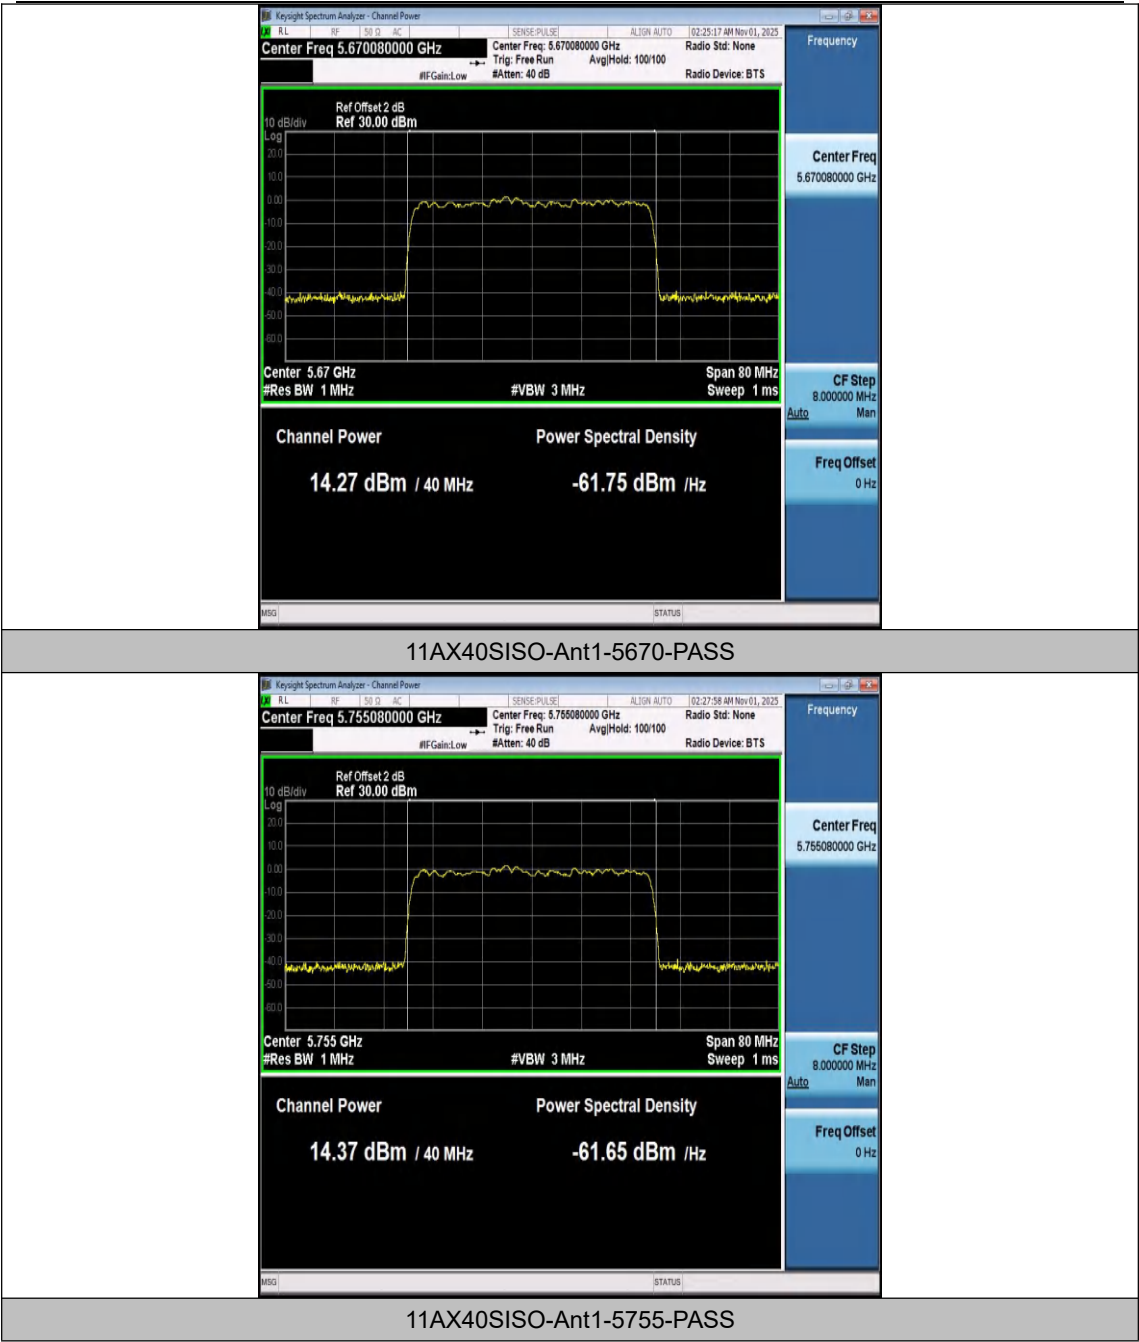

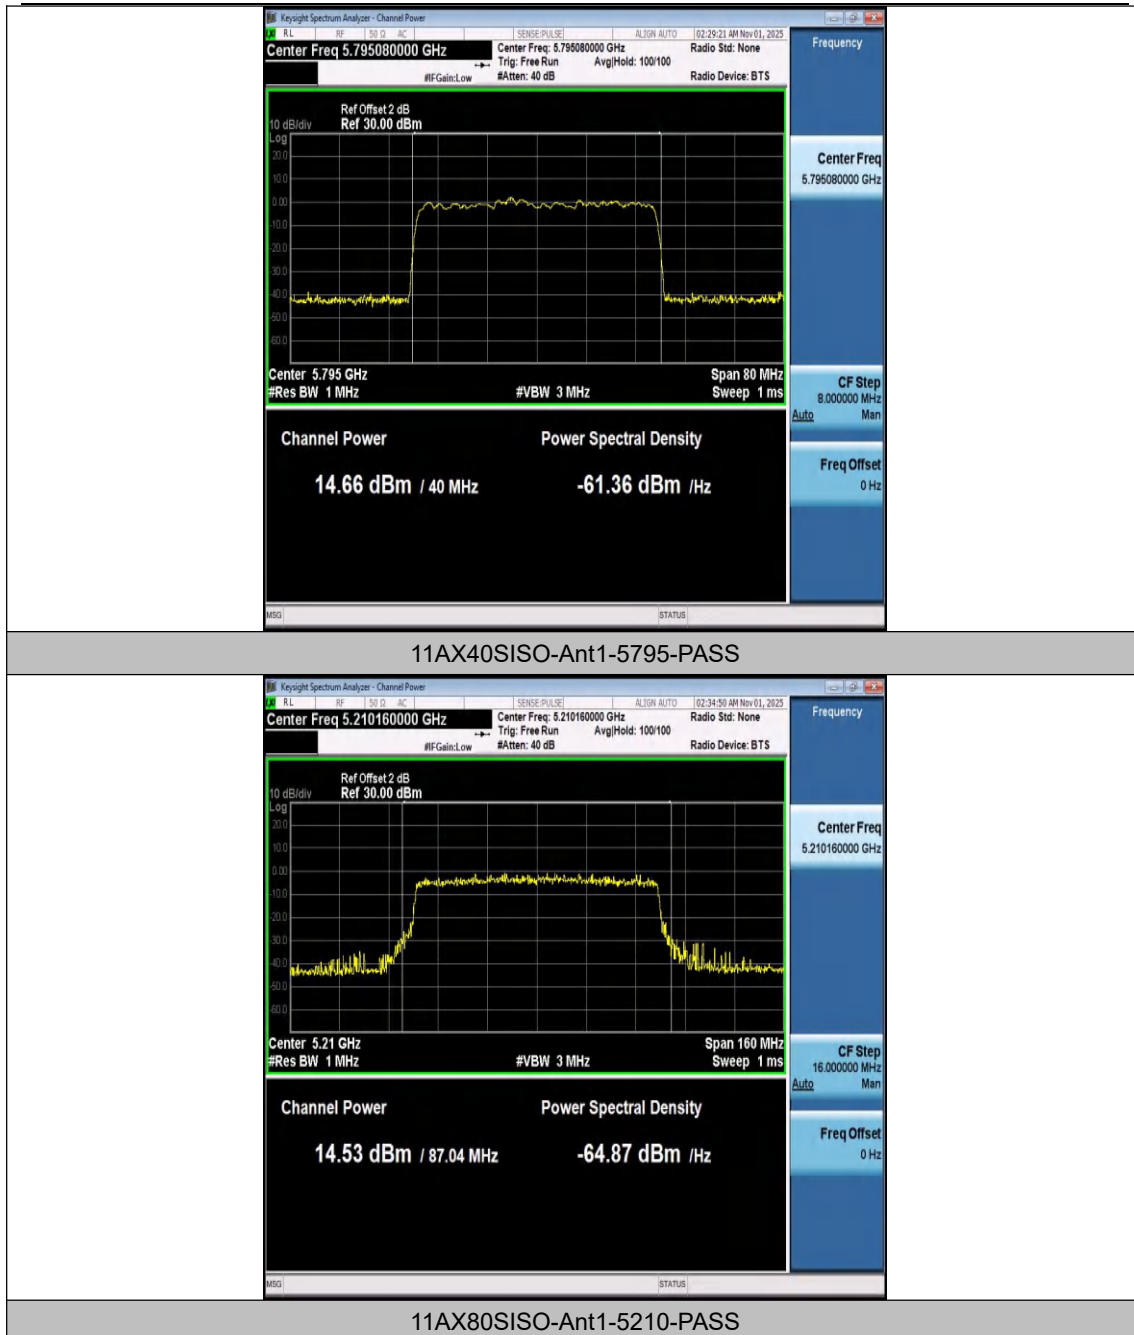

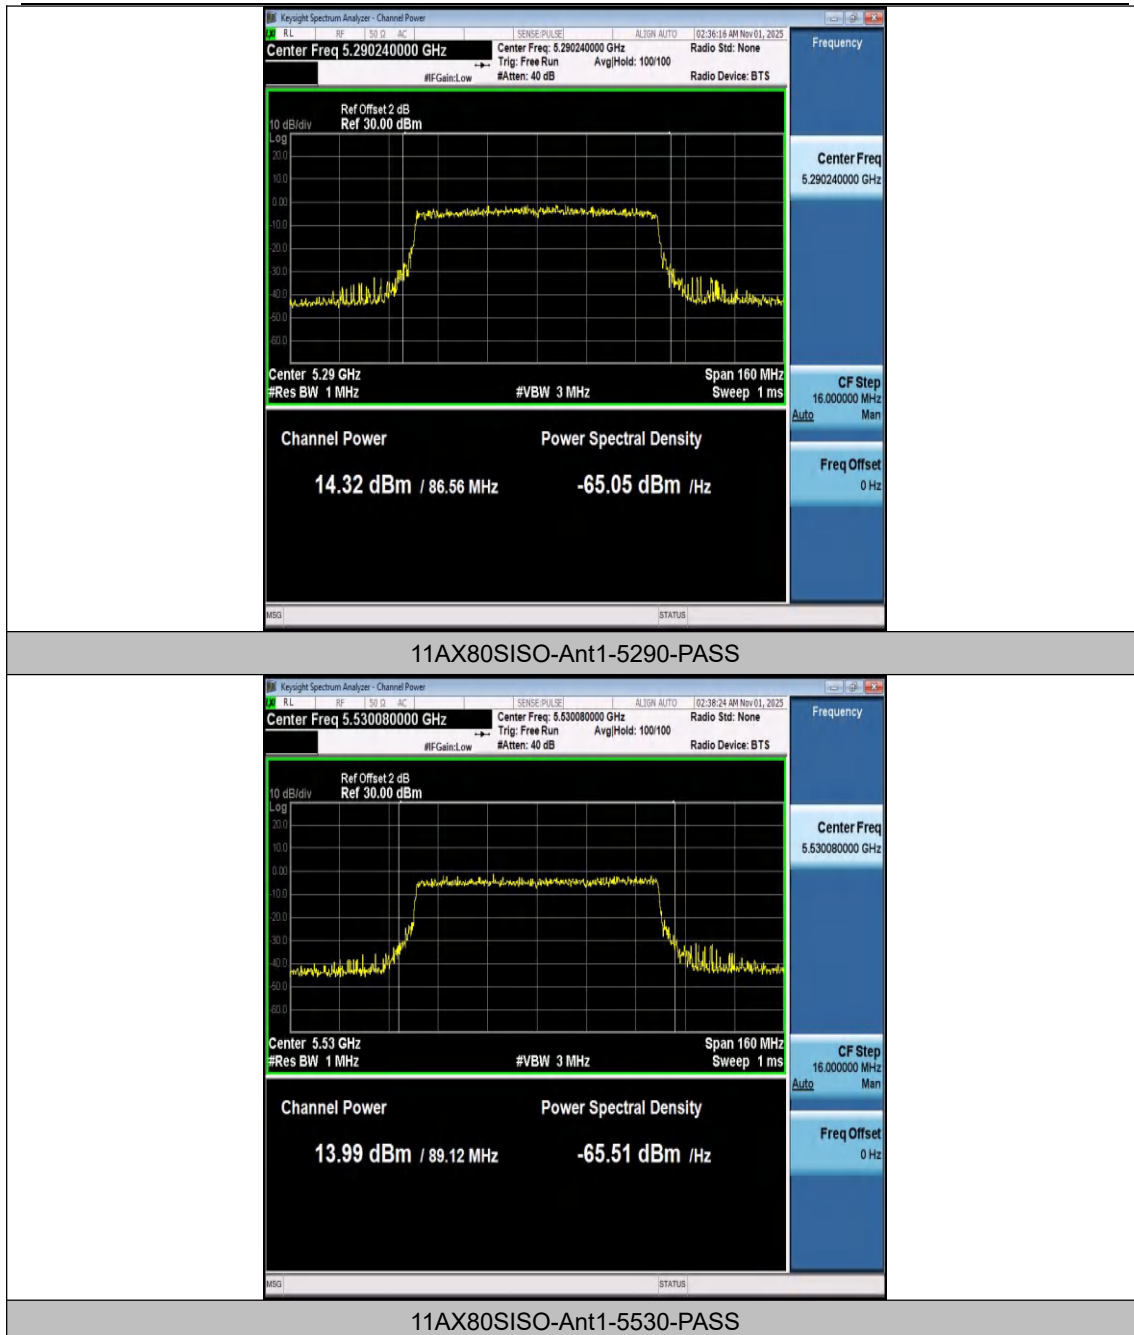

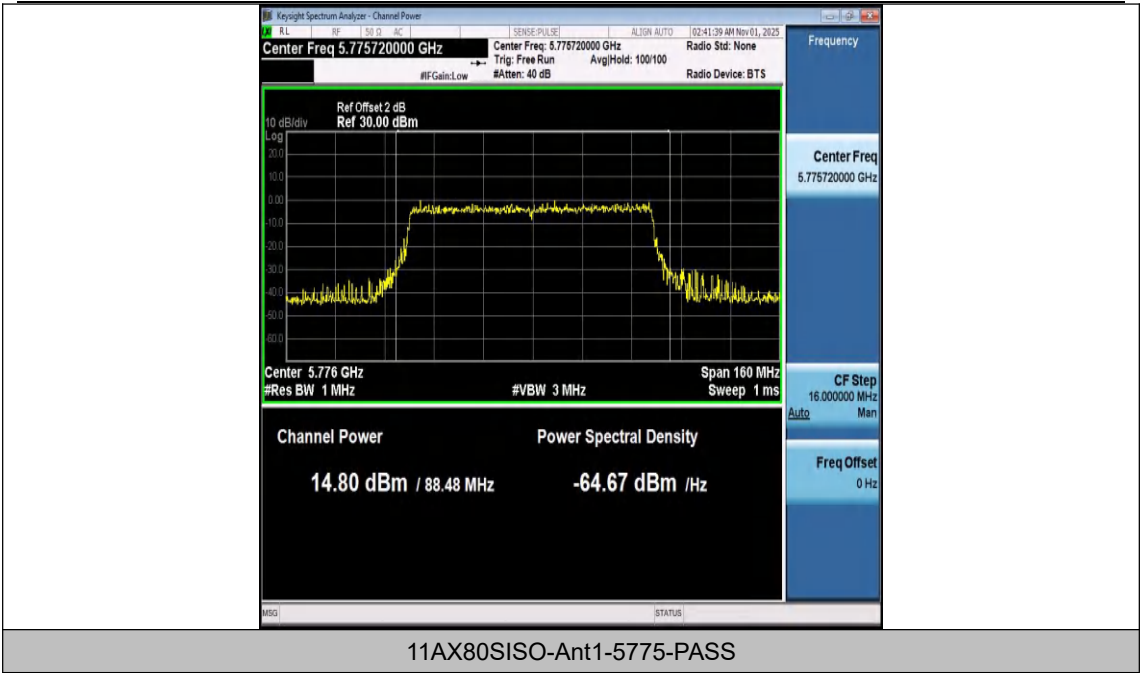

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1/2/3

Test Mode	Antenna	Frequency [MHz]	Reading Result[dBm/MHz]	DC Factor [dBm]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	0.77	0.00	0.77	≤11.00	PASS
11A	Ant1	5220	0.44	0.00	0.44	≤11.00	PASS
11A	Ant1	5240	0.03	0.00	0.03	≤11.00	PASS
11A	Ant1	5260	-0.04	0.00	-0.04	≤11.00	PASS
11A	Ant1	5300	0.55	0.00	0.55	≤11.00	PASS
11A	Ant1	5320	0.48	0.00	0.48	≤11.00	PASS
11A	Ant1	5500	0.53	0.00	0.53	≤11.00	PASS
11A	Ant1	5580	0.05	0.00	0.05	≤11.00	PASS
11A	Ant1	5700	0.48	0.00	0.48	≤11.00	PASS
11N20SISO	Ant1	5180	-0.55	0.00	-0.55	≤11.00	PASS
11N20SISO	Ant1	5220	-0.68	0.00	-0.68	≤11.00	PASS
11N20SISO	Ant1	5240	0.09	0.00	0.09	≤11.00	PASS
11N20SISO	Ant1	5260	0.19	0.00	0.19	≤11.00	PASS
11N20SISO	Ant1	5300	-0.77	0.00	-0.77	≤11.00	PASS
11N20SISO	Ant1	5320	-0.63	0.00	-0.63	≤11.00	PASS
11N20SISO	Ant1	5500	-0.15	0.00	-0.15	≤11.00	PASS
11N20SISO	Ant1	5580	-0.04	0.00	-0.04	≤11.00	PASS
11N20SISO	Ant1	5700	0.30	0.00	0.30	≤11.00	PASS
11N40SISO	Ant1	5190	-2.40	0.00	-2.40	≤11.00	PASS
11N40SISO	Ant1	5230	-2.88	0.00	-2.88	≤11.00	PASS
11N40SISO	Ant1	5270	-3.36	0.00	-3.36	≤11.00	PASS
11N40SISO	Ant1	5310	-3.28	0.00	-3.28	≤11.00	PASS
11N40SISO	Ant1	5510	-3.26	0.00	-3.26	≤11.00	PASS
11N40SISO	Ant1	5550	-2.82	0.00	-2.82	≤11.00	PASS
11N40SISO	Ant1	5670	-2.74	0.00	-2.74	≤11.00	PASS
11AC20SISO	Ant1	5180	-0.58	0.00	-0.58	≤11.00	PASS
11AC20SISO	Ant1	5220	0.27	0.00	0.27	≤11.00	PASS
11AC20SISO	Ant1	5240	-0.03	0.00	-0.03	≤11.00	PASS
11AC20SISO	Ant1	5260	-0.52	0.00	-0.52	≤11.00	PASS
11AC20SISO	Ant1	5300	0.25	0.00	0.25	≤11.00	PASS
11AC20SISO	Ant1	5320	0.73	0.00	0.73	≤11.00	PASS
11AC20SISO	Ant1	5500	0.82	0.00	0.82	≤11.00	PASS
11AC20SISO	Ant1	5580	-0.28	0.00	-0.28	≤11.00	PASS
11AC20SISO	Ant1	5700	0.15	0.00	0.15	≤11.00	PASS
11AC40SISO	Ant1	5190	-2.68	0.00	-2.68	≤11.00	PASS
11AC40SISO	Ant1	5230	-2.49	0.00	-2.49	≤11.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC40SISO	Ant1	5270	-3.55	0.00	-3.55	≤11.00	PASS
11AC40SISO	Ant1	5310	-3.52	0.00	-3.52	≤11.00	PASS
11AC40SISO	Ant1	5510	-2.17	0.00	-2.17	≤11.00	PASS
11AC40SISO	Ant1	5550	-2.78	0.00	-2.78	≤11.00	PASS
11AC40SISO	Ant1	5670	-2.74	0.00	-2.74	≤11.00	PASS
11AC80SISO	Ant1	5210	-8.97	0.00	-8.97	≤11.00	PASS
11AC80SISO	Ant1	5290	-8.25	0.00	-8.25	≤11.00	PASS
11AC80SISO	Ant1	5530	-10.44	0.00	-10.44	≤11.00	PASS
11AX20SISO	Ant1	5180	-2.79	0.00	-2.79	≤11.00	PASS
11AX20SISO	Ant1	5220	-1.86	0.00	-1.86	≤11.00	PASS
11AX20SISO	Ant1	5240	-1.96	0.00	-1.96	≤11.00	PASS
11AX20SISO	Ant1	5260	-2.41	0.00	-2.41	≤11.00	PASS
11AX20SISO	Ant1	5300	-1.77	0.00	-1.77	≤11.00	PASS
11AX20SISO	Ant1	5320	-1.52	0.00	-1.52	≤11.00	PASS
11AX20SISO	Ant1	5500	-1.96	0.00	-1.96	≤11.00	PASS
11AX20SISO	Ant1	5580	-2.00	0.00	-2.00	≤11.00	PASS
11AX20SISO	Ant1	5700	-1.73	0.00	-1.73	≤11.00	PASS
11AX40SISO	Ant1	5190	-4.95	0.00	-4.95	≤11.00	PASS
11AX40SISO	Ant1	5230	-4.85	0.00	-4.85	≤11.00	PASS
11AX40SISO	Ant1	5270	-4.32	0.00	-4.32	≤11.00	PASS
11AX40SISO	Ant1	5310	-4.71	0.00	-4.71	≤11.00	PASS
11AX40SISO	Ant1	5510	-4.46	0.00	-4.46	≤11.00	PASS
11AX40SISO	Ant1	5550	-4.83	0.00	-4.83	≤11.00	PASS
11AX40SISO	Ant1	5670	-4.78	0.00	-4.78	≤11.00	PASS
11AX80SISO	Ant1	5210	-9.05	0.00	-9.05	≤11.00	PASS
11AX80SISO	Ant1	5290	-9.96	0.00	-9.96	≤11.00	PASS
11AX80SISO	Ant1	5530	-9.89	0.00	-9.89	≤11.00	PASS

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.

Test Result B4

Test Mode	Antenna	Frequency [MHz]	Reading Result [dBm/510KHz]	DC Factor [dBm]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-2.28	0.00	-2.37	≤30.00	PASS
11A	Ant1	5785	-1.88	0.00	-1.97	≤30.00	PASS
11A	Ant1	5825	-3.03	0.00	-3.12	≤30.00	PASS
11N20SISO	Ant1	5745	-2.55	0.00	-2.64	≤30.00	PASS
11N20SISO	Ant1	5785	-3.32	0.00	-3.41	≤30.00	PASS
11N20SISO	Ant1	5825	-3.05	0.00	-3.14	≤30.00	PASS
11N40SISO	Ant1	5755	-5.78	0.00	-5.87	≤30.00	PASS
11N40SISO	Ant1	5795	-6.53	0.00	-6.62	≤30.00	PASS
11AC20SISO	Ant1	5745	-2.71	0.00	-2.80	≤30.00	PASS
11AC20SISO	Ant1	5785	-3.23	0.00	-3.32	≤30.00	PASS
11AC20SISO	Ant1	5825	-3.36	0.00	-3.45	≤30.00	PASS
11AC40SISO	Ant1	5755	-5.78	0.00	-5.87	≤30.00	PASS
11AC40SISO	Ant1	5795	-6.14	0.00	-6.23	≤30.00	PASS
11AC80SISO	Ant1	5775	-12.38	0.00	-12.47	≤30.00	PASS
11AX20SISO	Ant1	5745	-4.87	0.00	-4.96	≤30.00	PASS
11AX20SISO	Ant1	5785	-4.64	0.00	-4.73	≤30.00	PASS
11AX20SISO	Ant1	5825	-5.14	0.00	-5.23	≤30.00	PASS
11AX40SISO	Ant1	5755	-7.78	0.00	-7.87	≤30.00	PASS
11AX40SISO	Ant1	5795	-7.49	0.00	-7.58	≤30.00	PASS
11AX80SISO	Ant1	5775	-11.82	0.00	-11.91	≤30.00	PASS

Note: 1.The cable loss and RBW Factor are compensated in the graph.

2.Offset=cable loss(2dB) + RBW Factor (-0.09dB)


Test Graphs B1/2/3



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

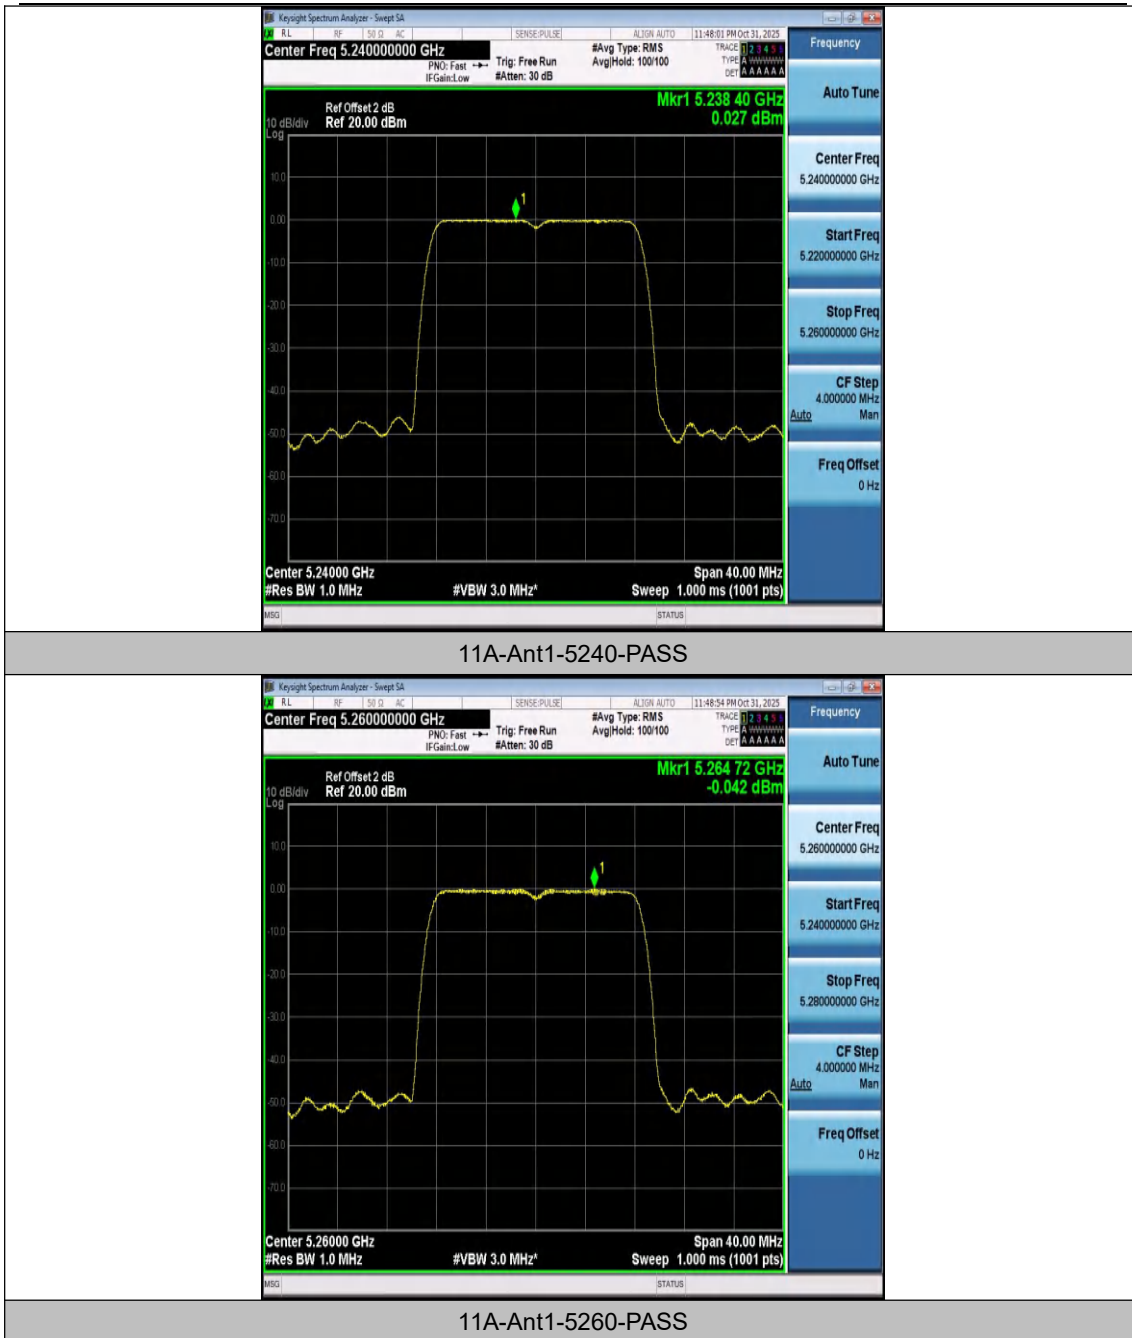

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

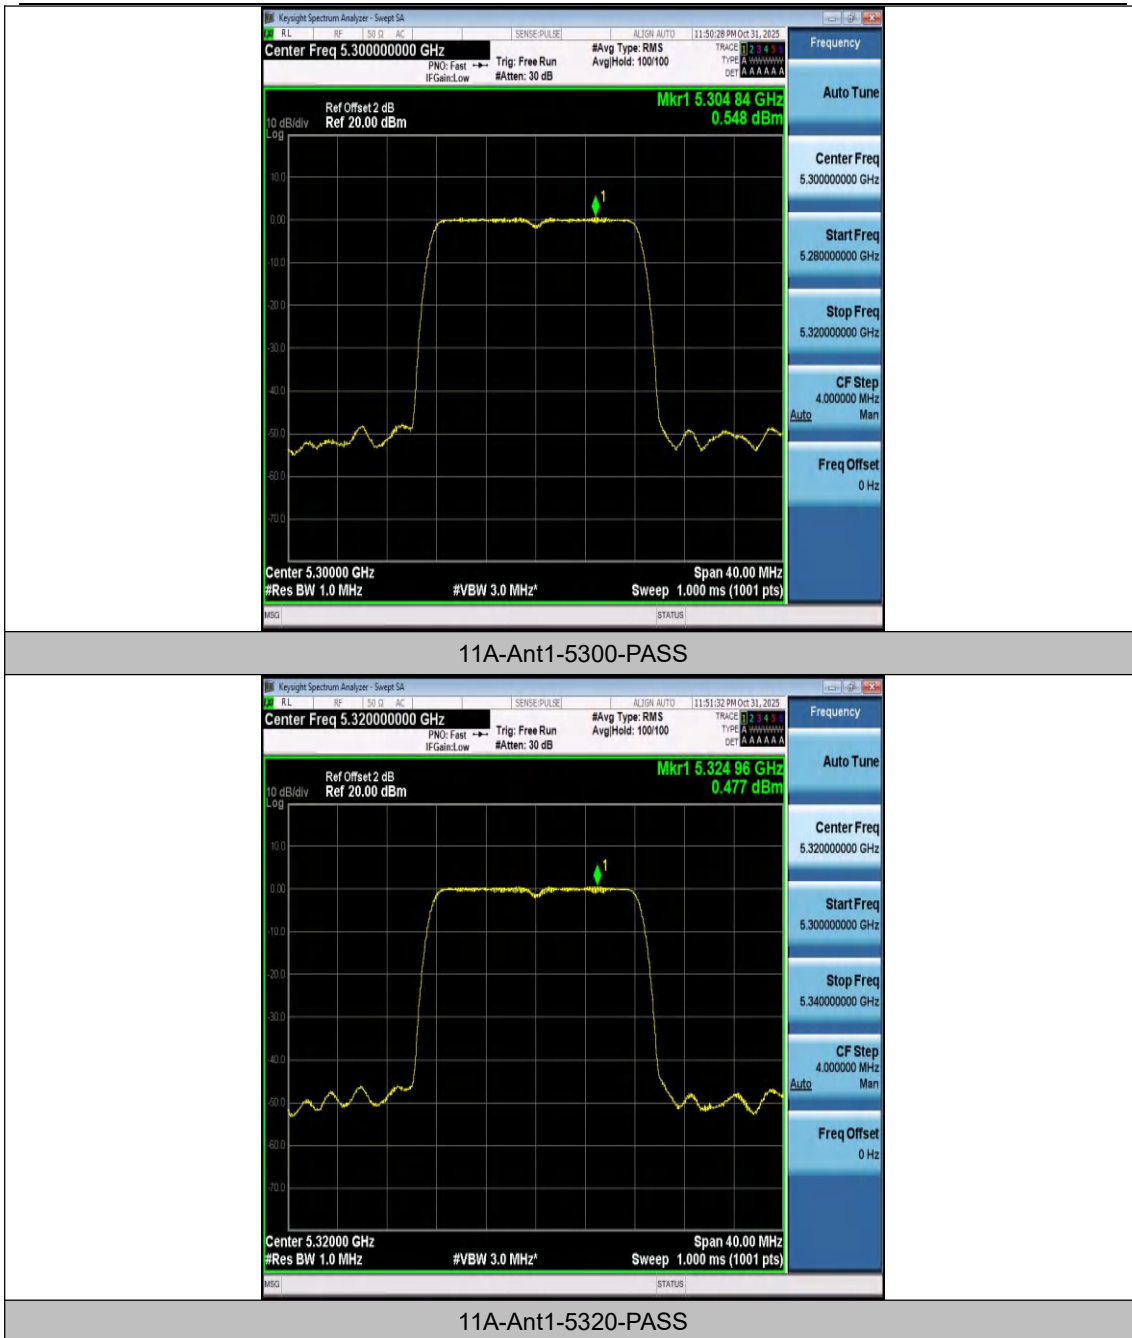

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

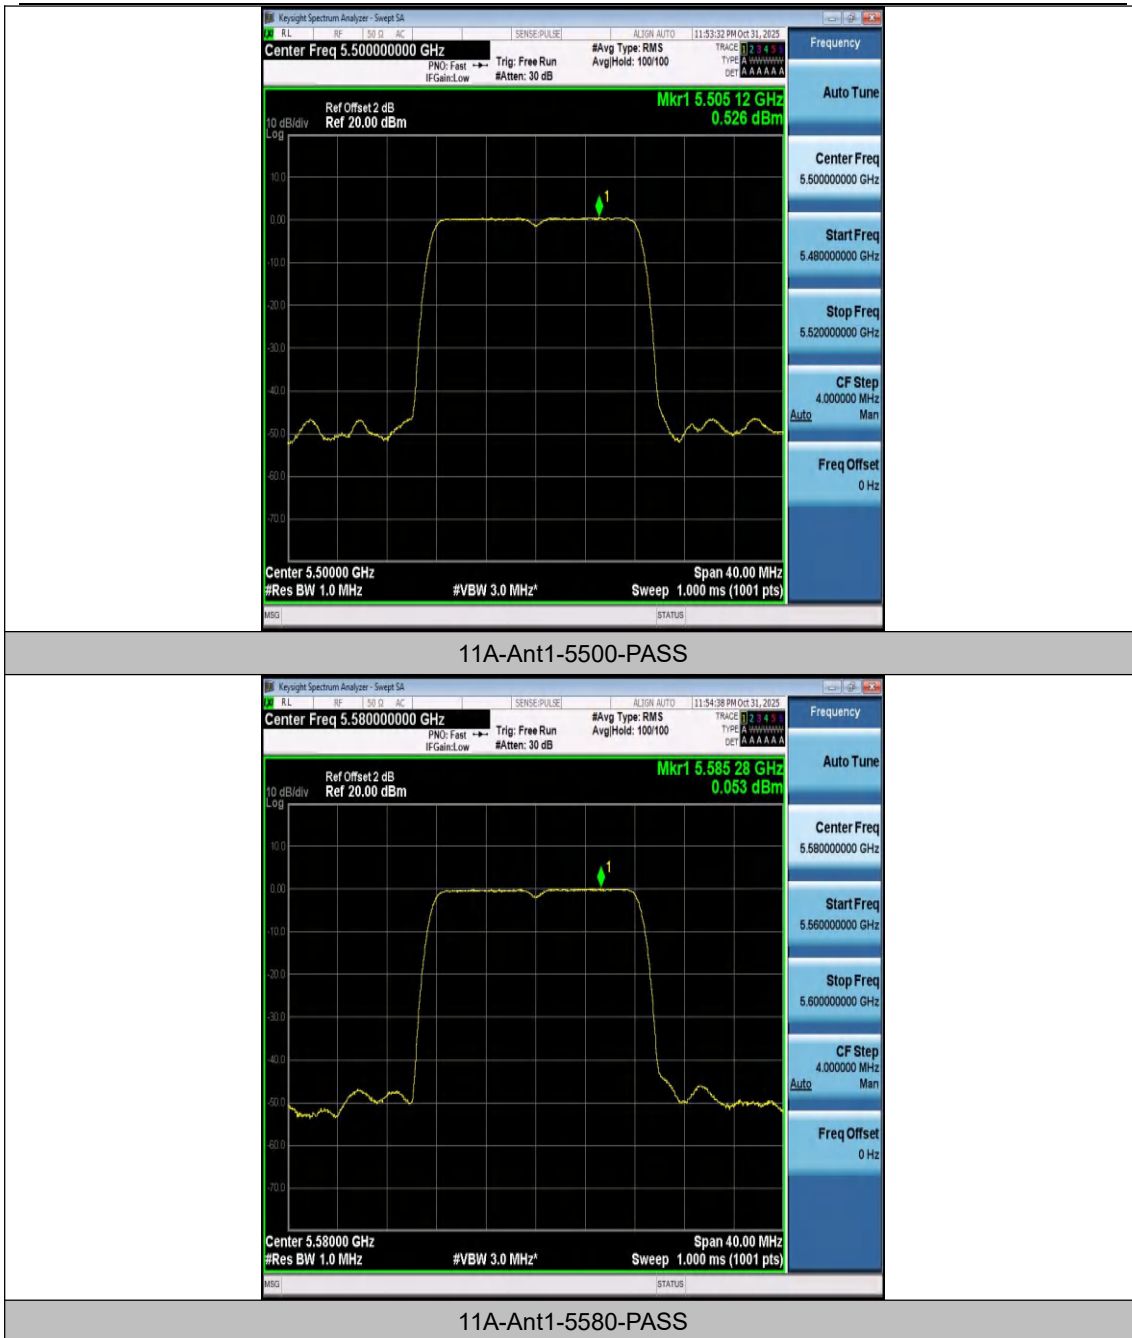

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

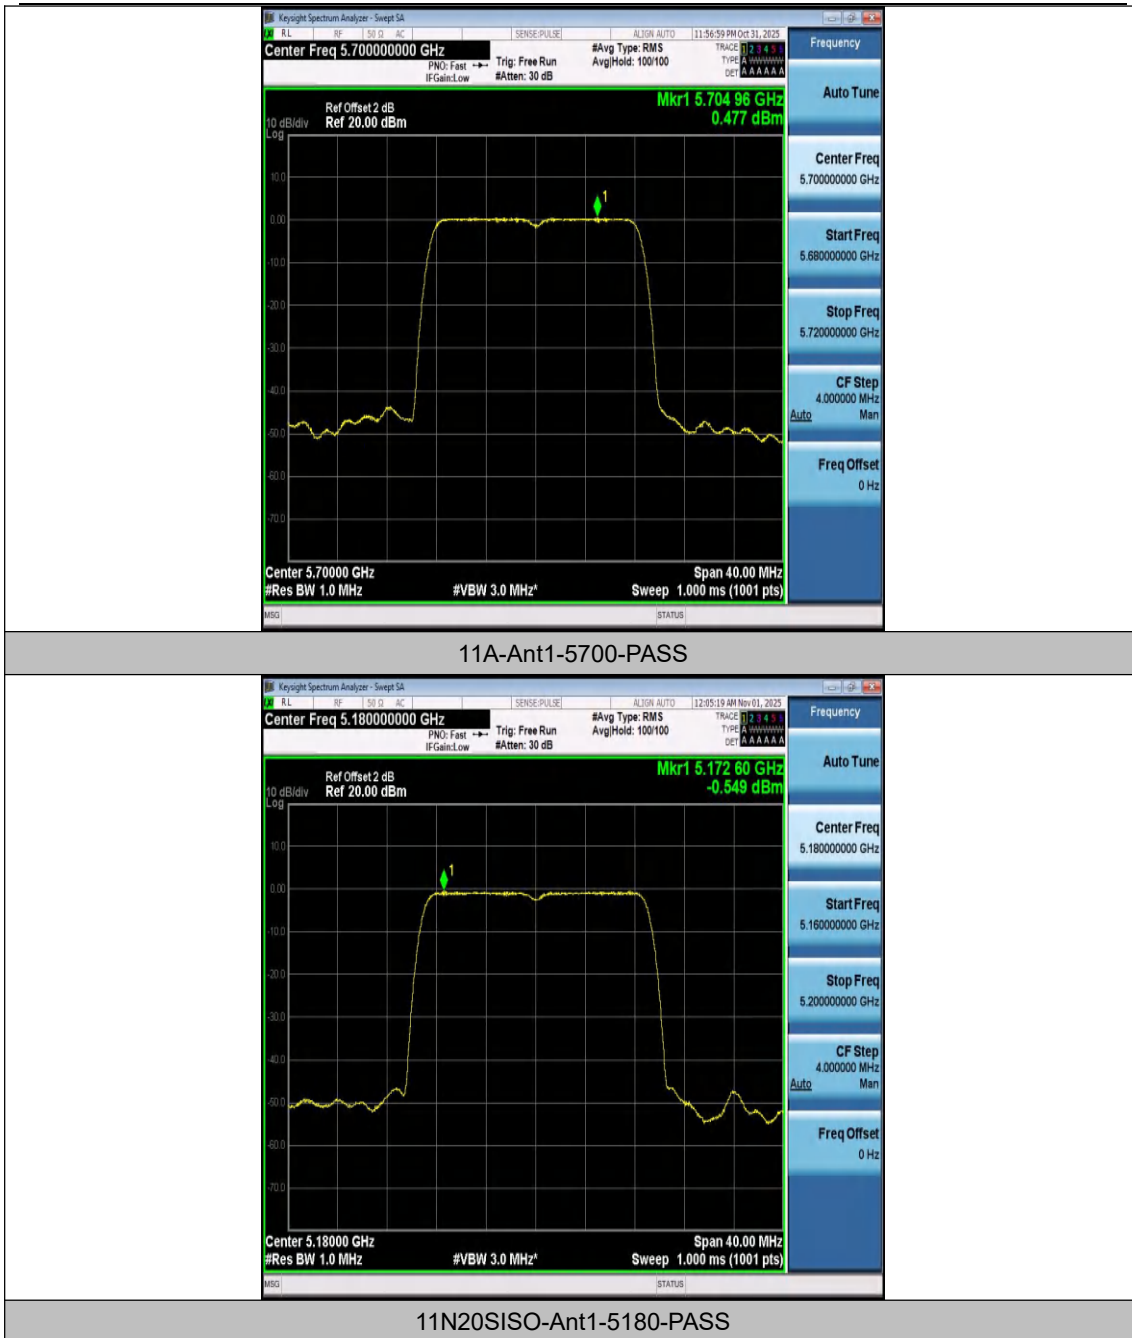

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

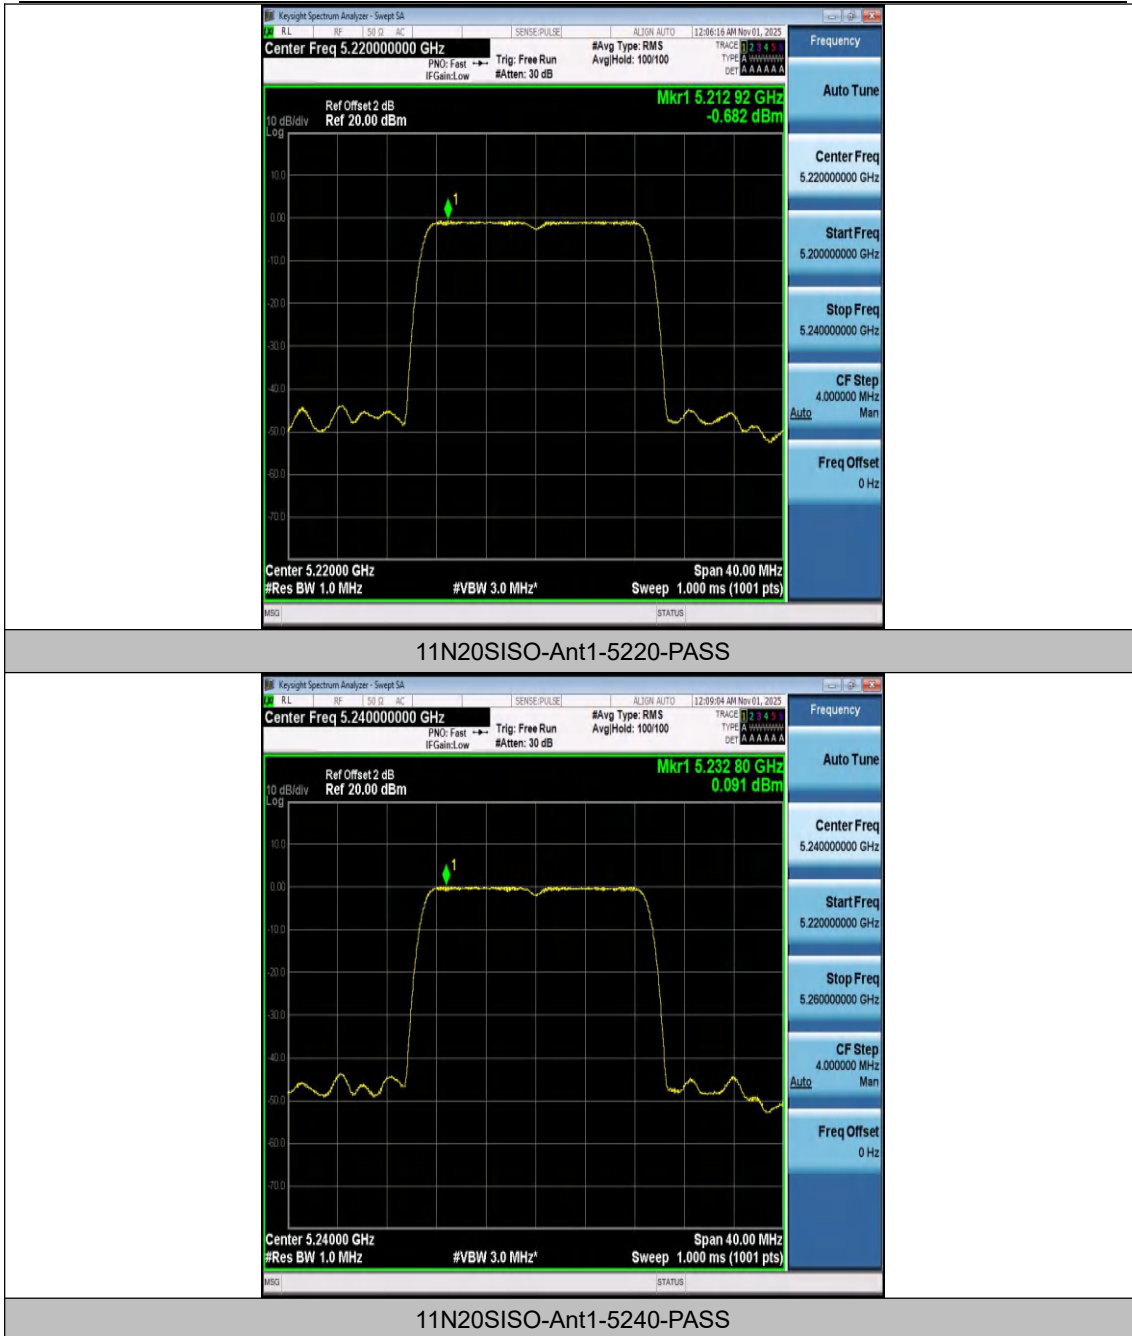

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

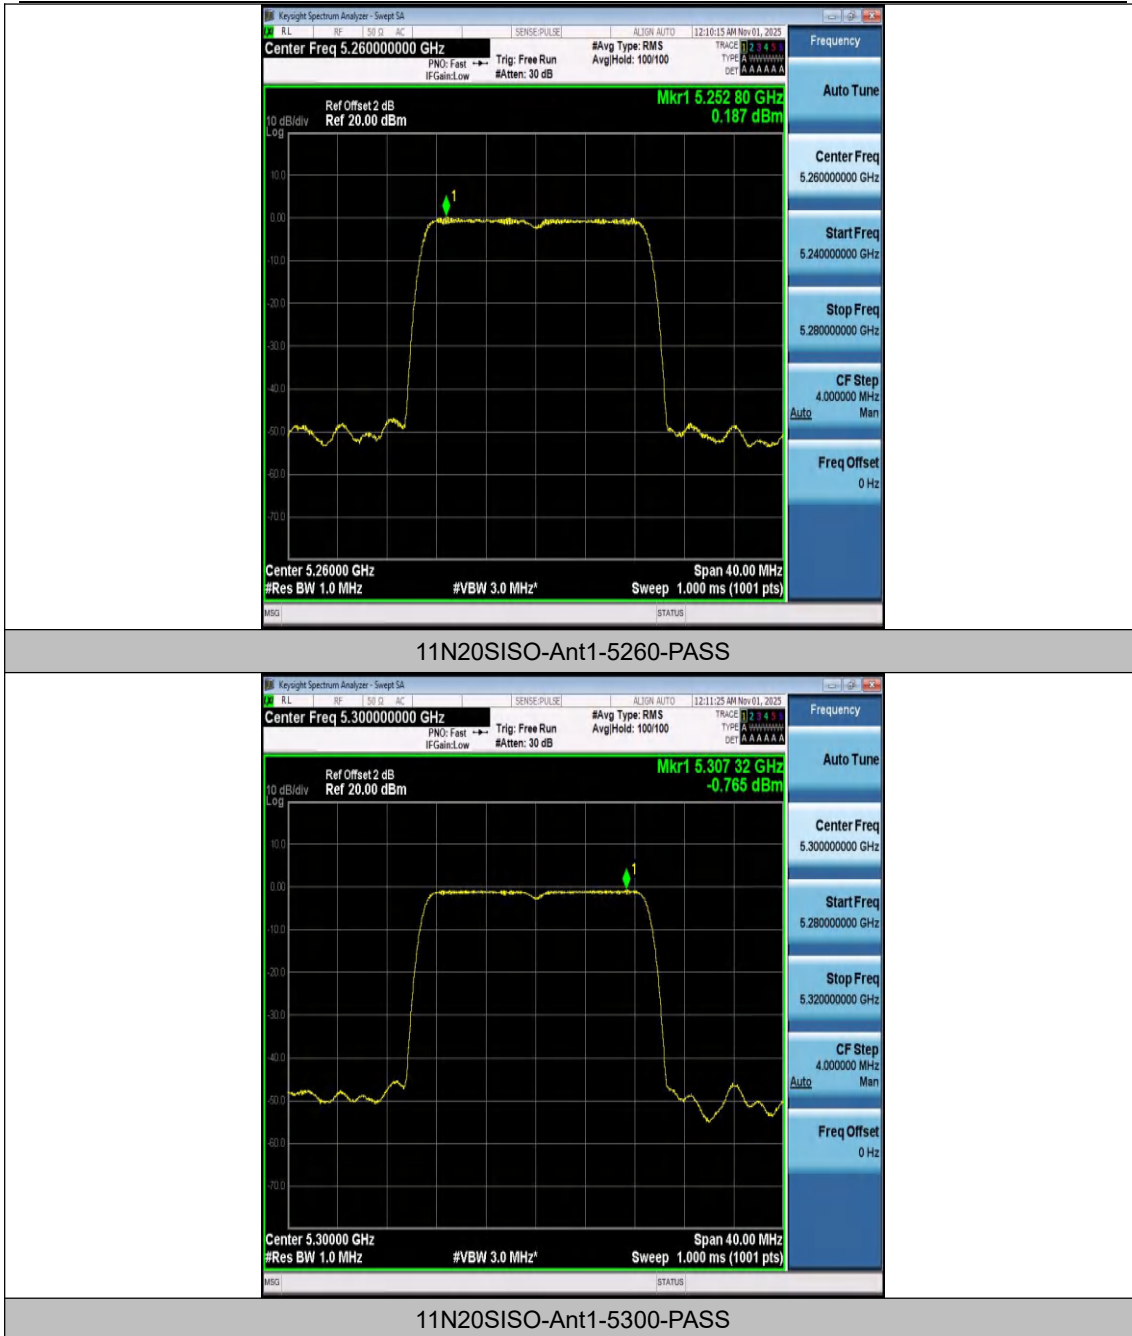

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

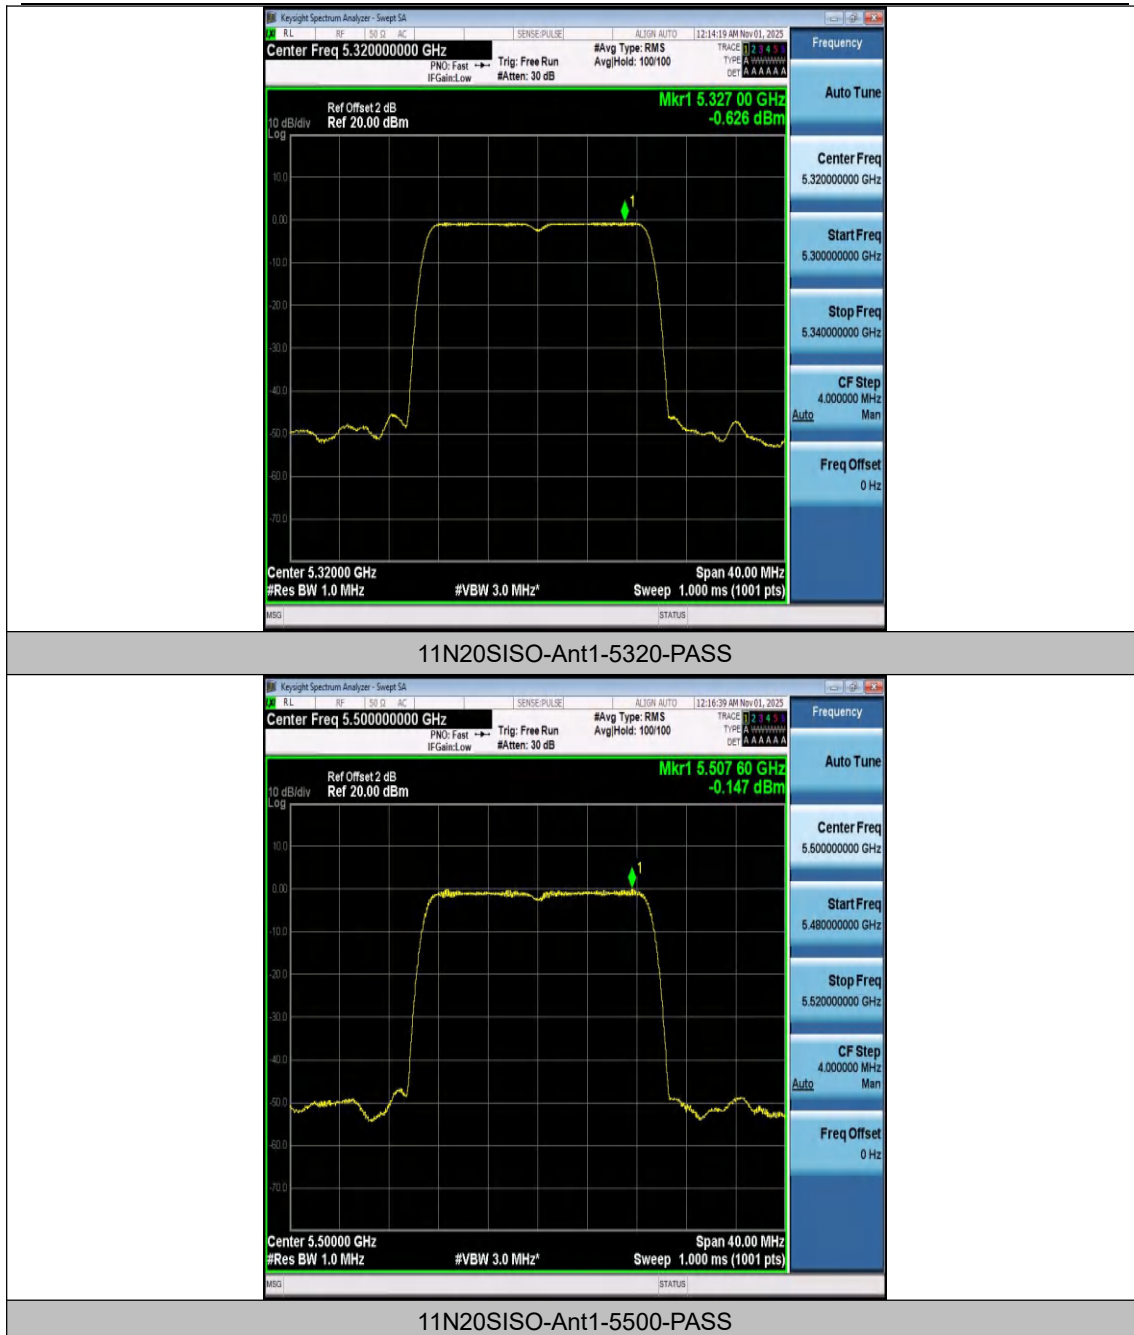

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

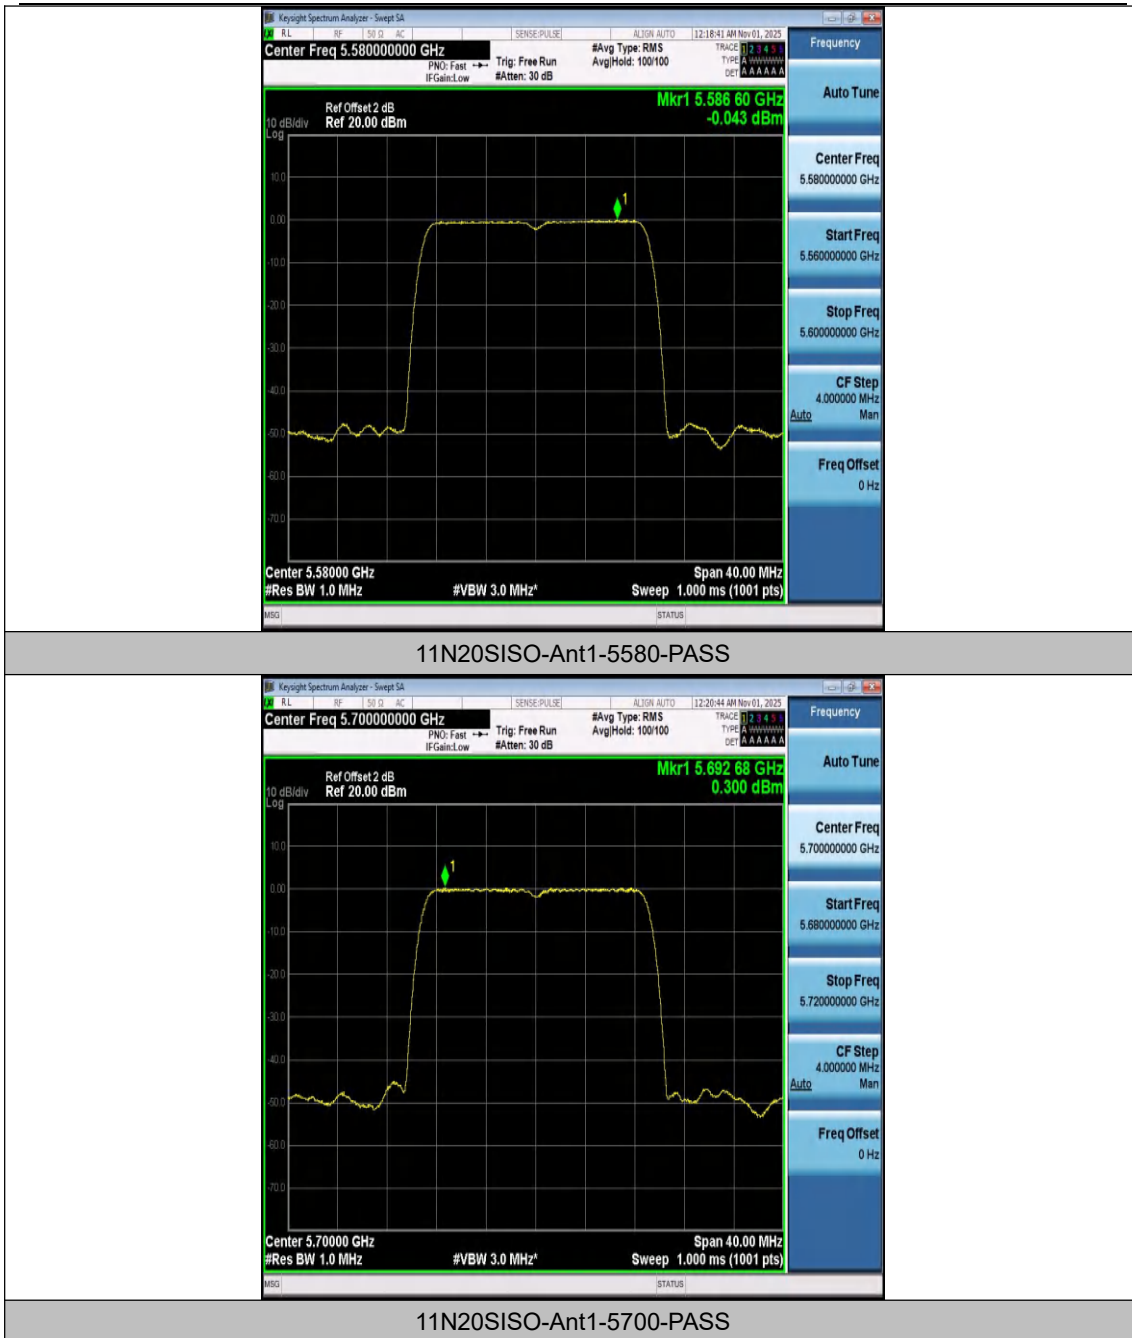

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

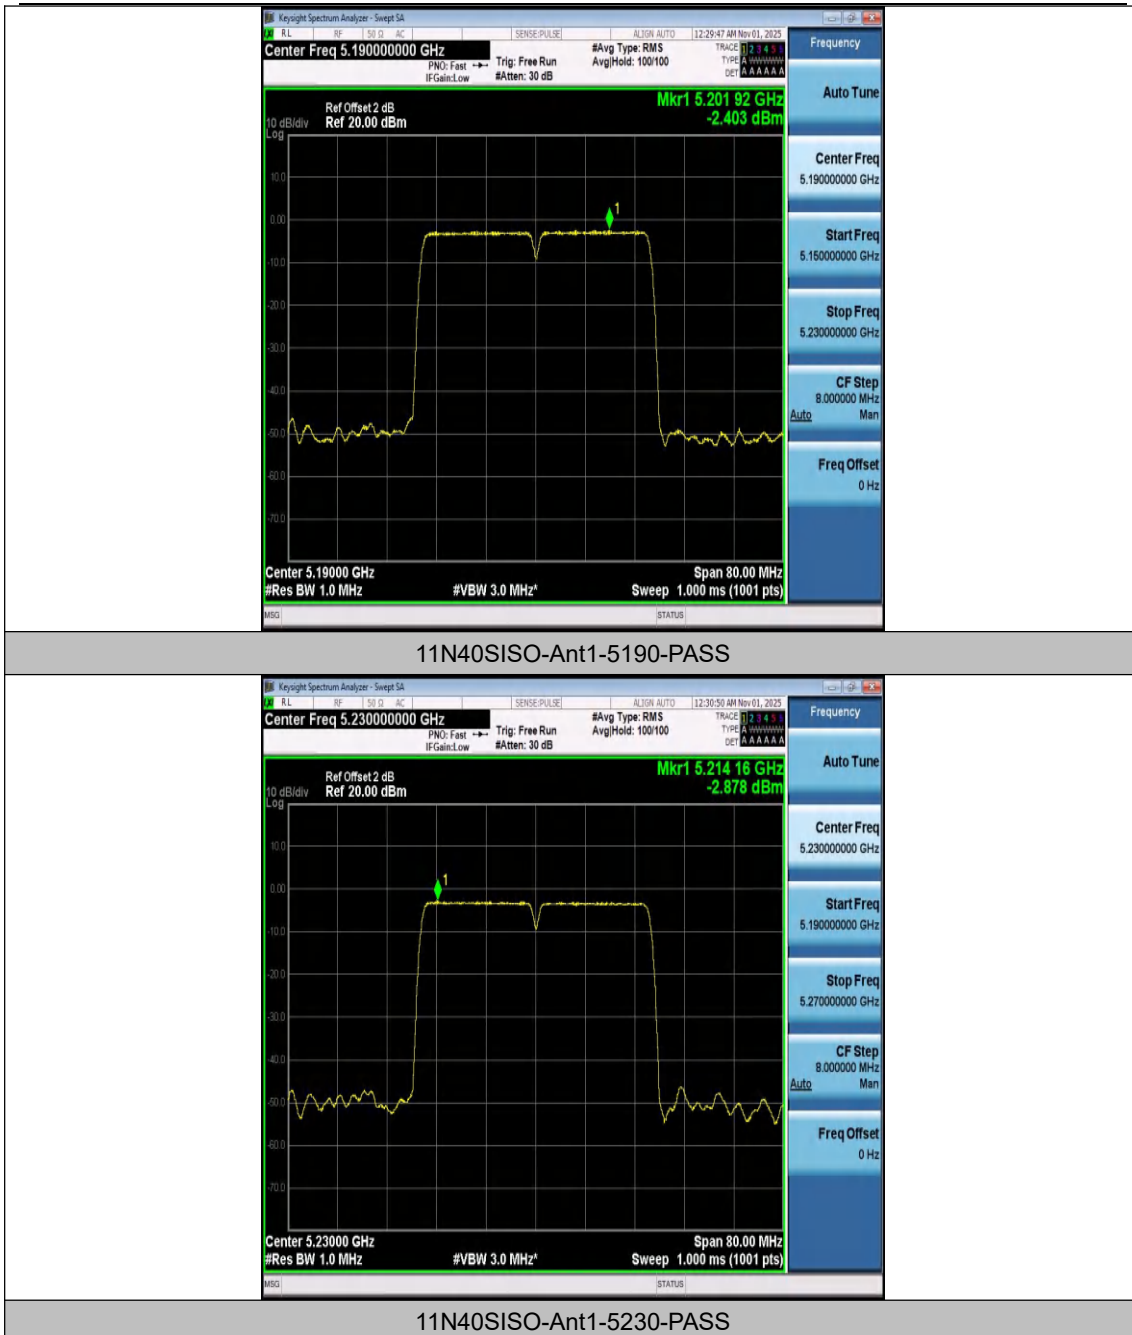

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

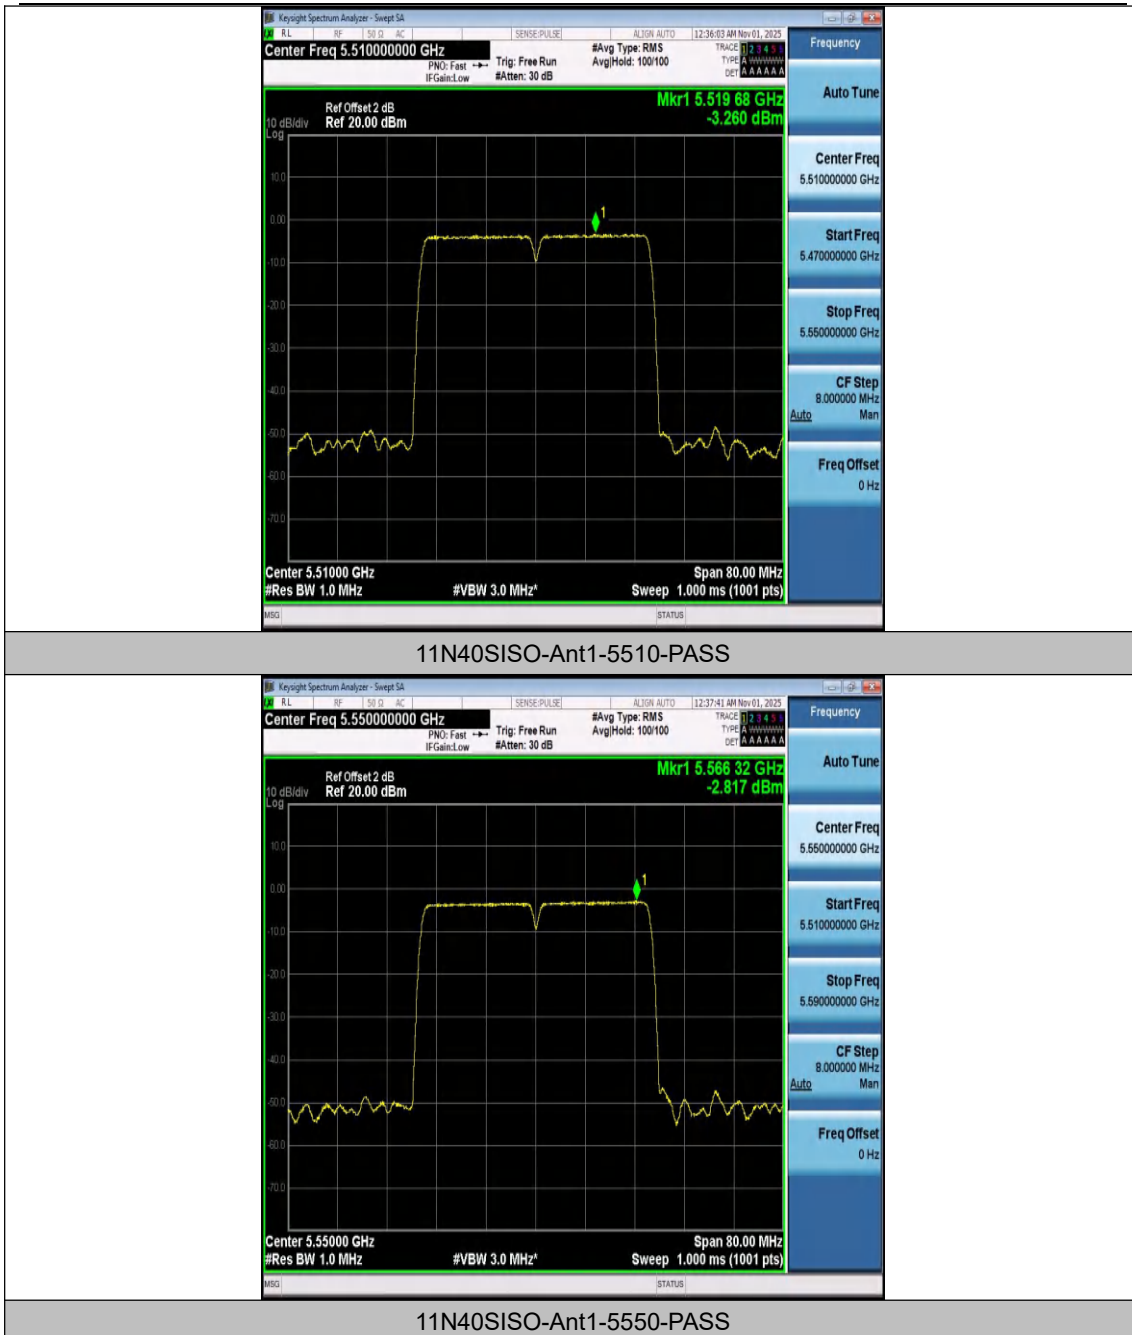

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

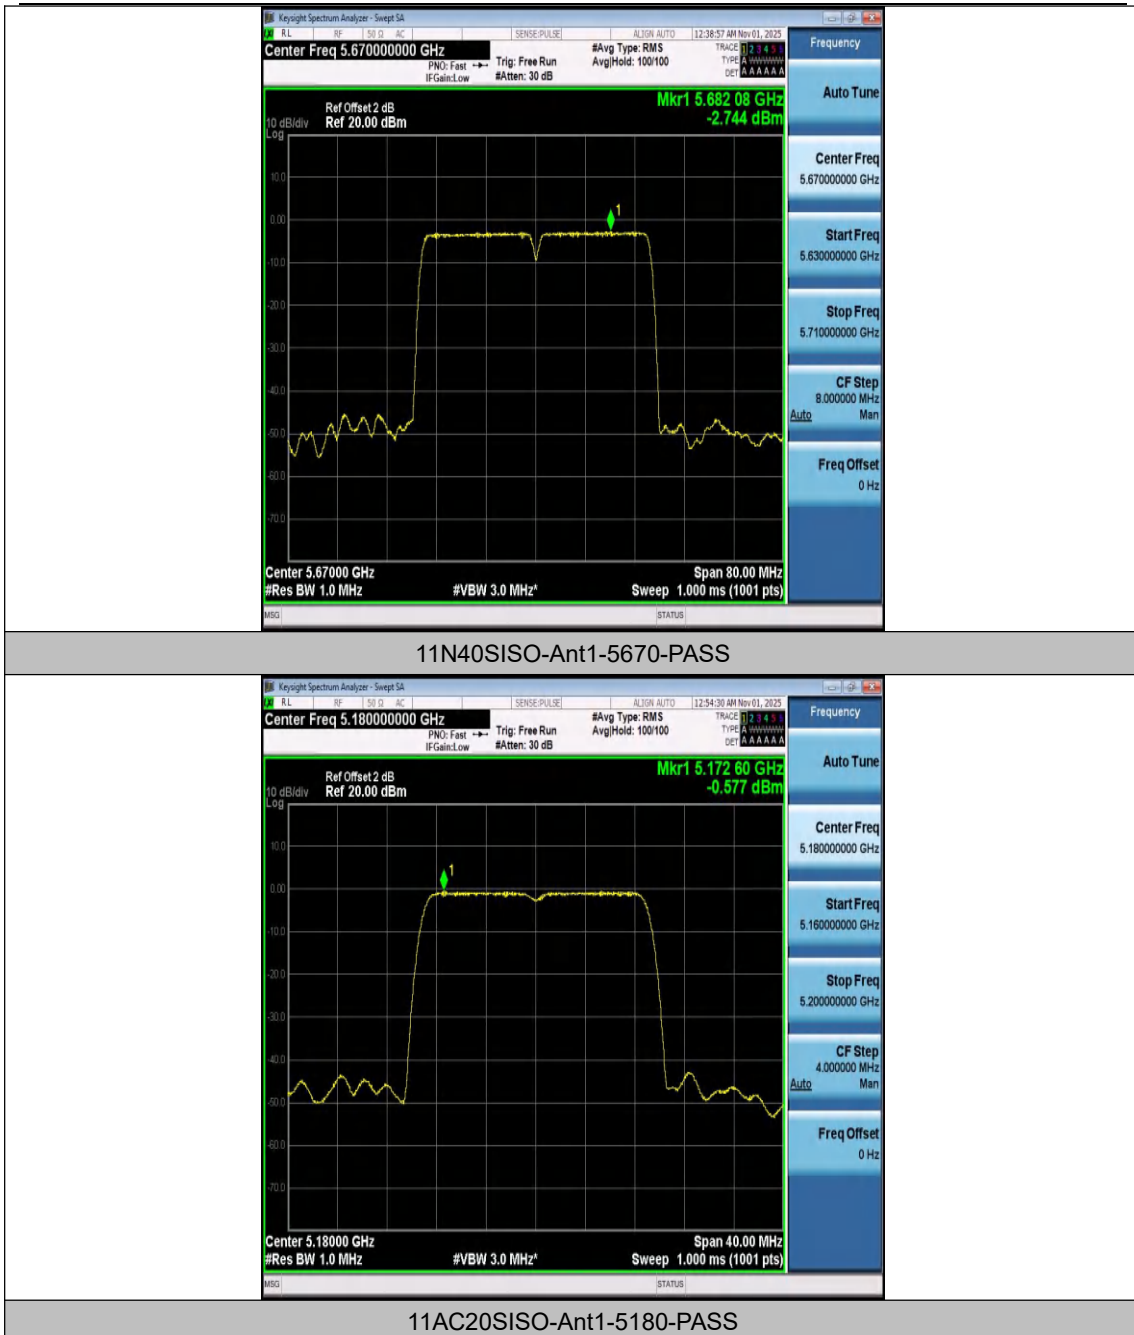

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

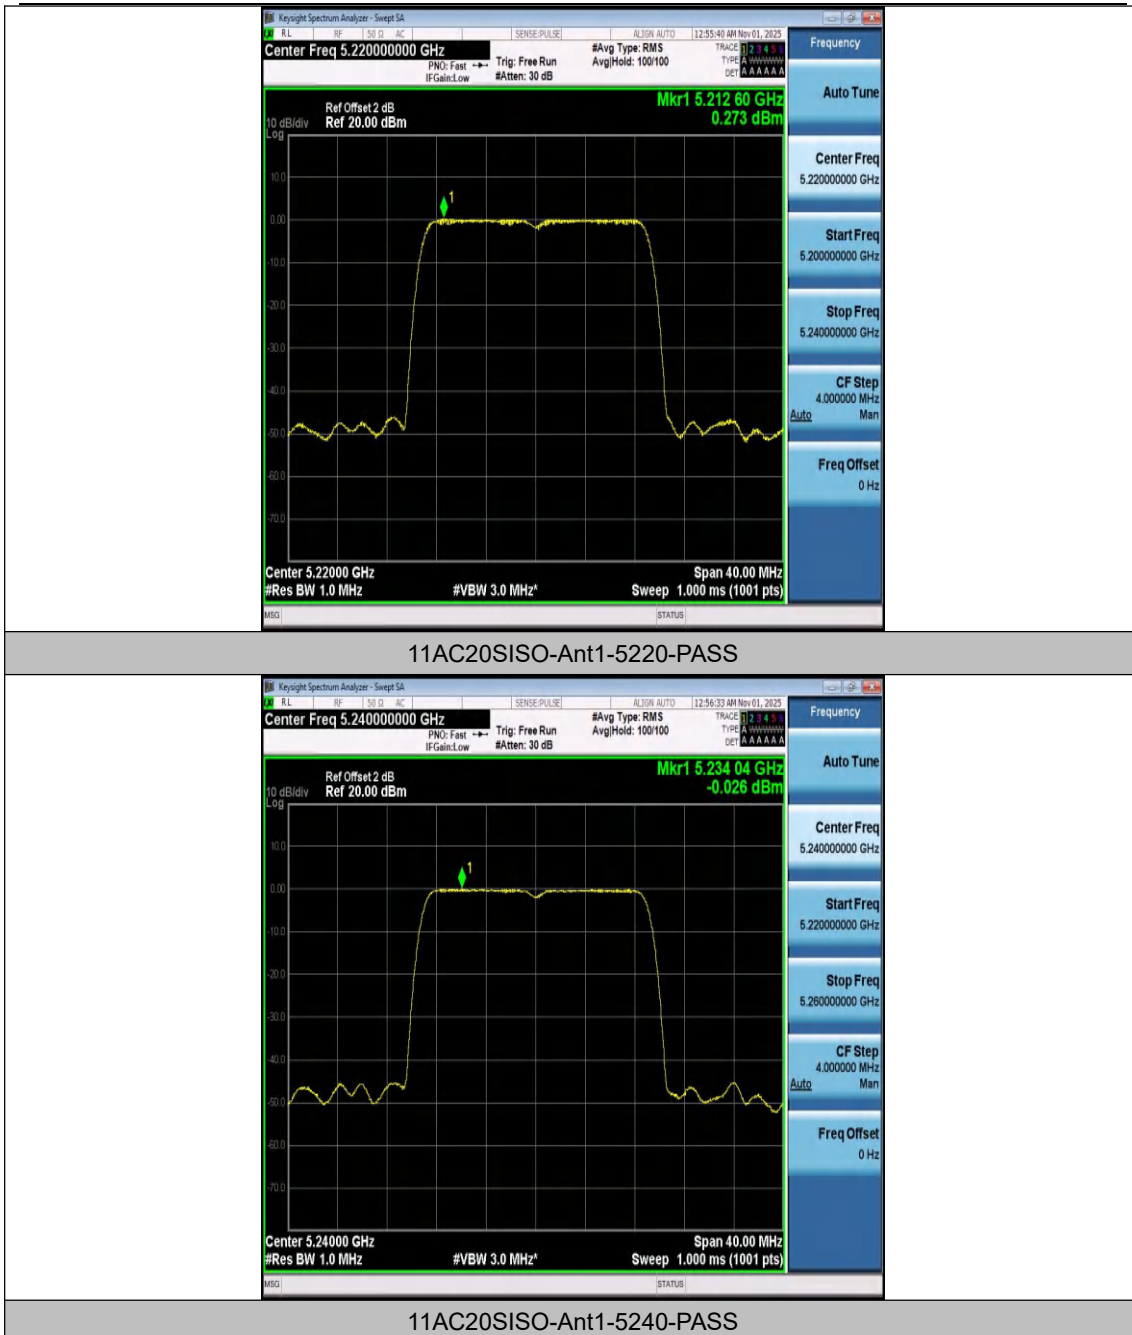

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

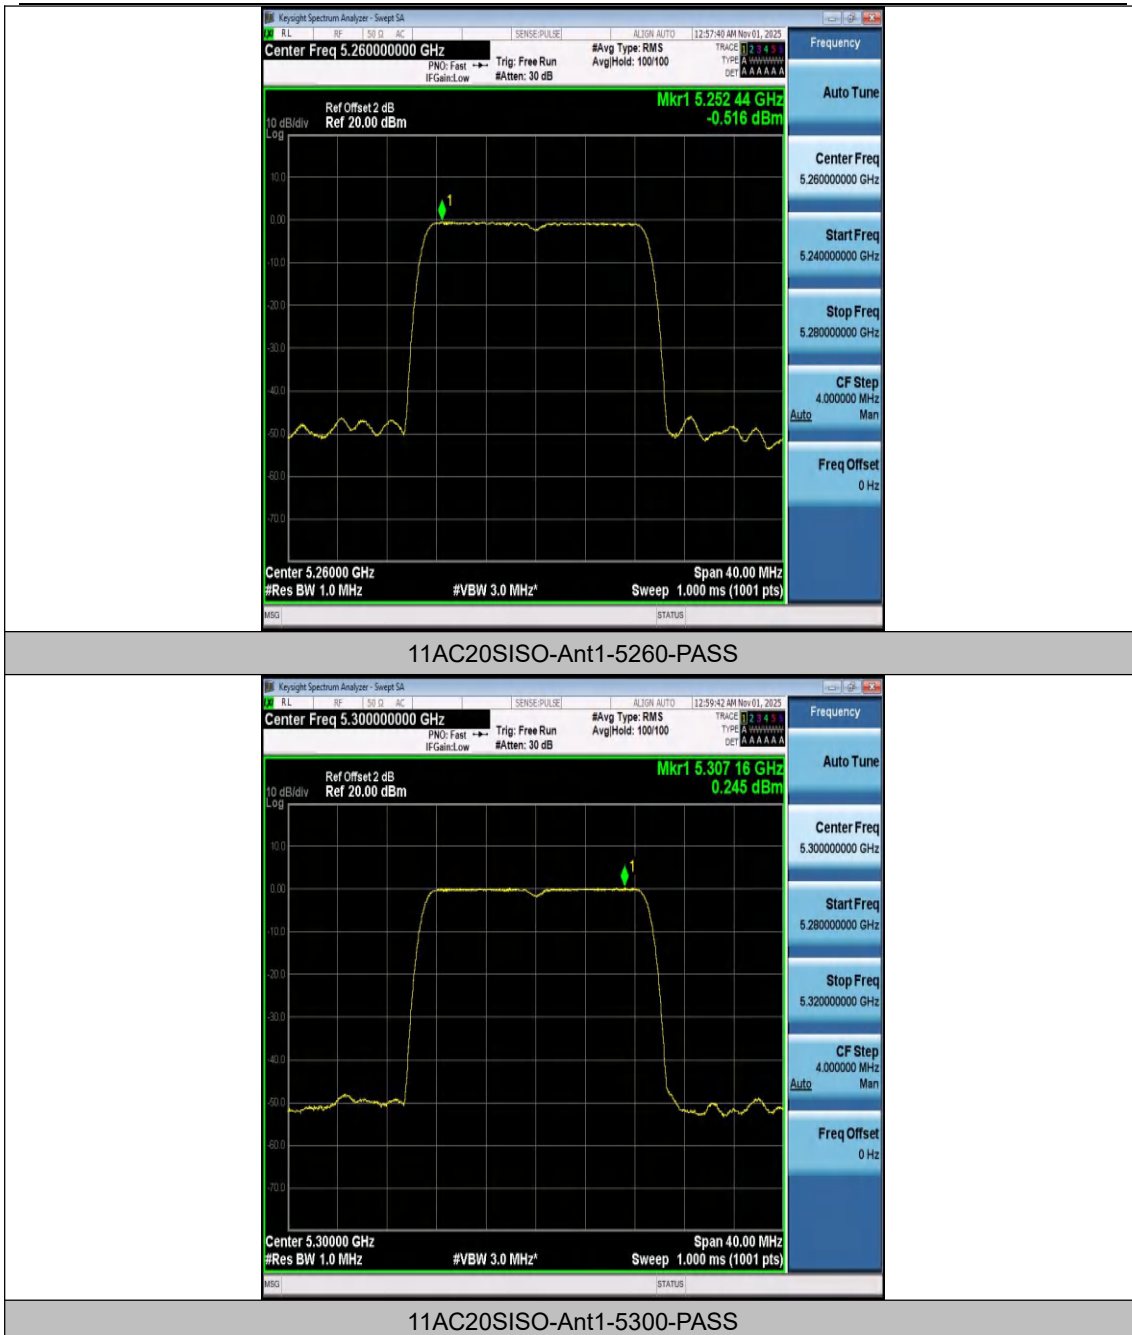

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

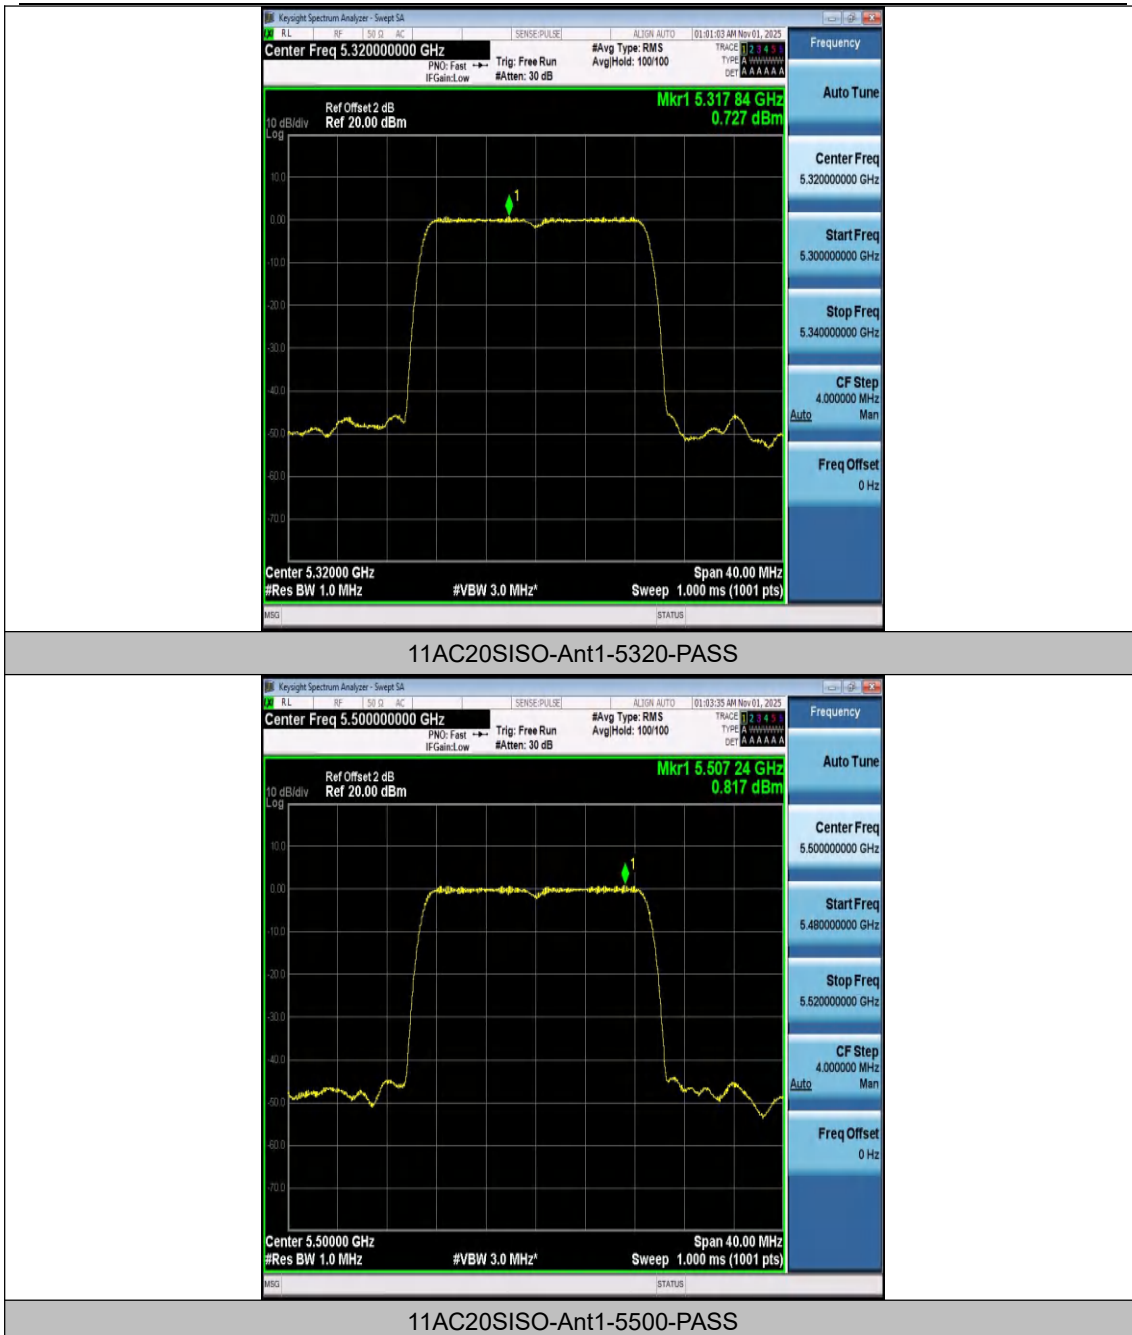

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

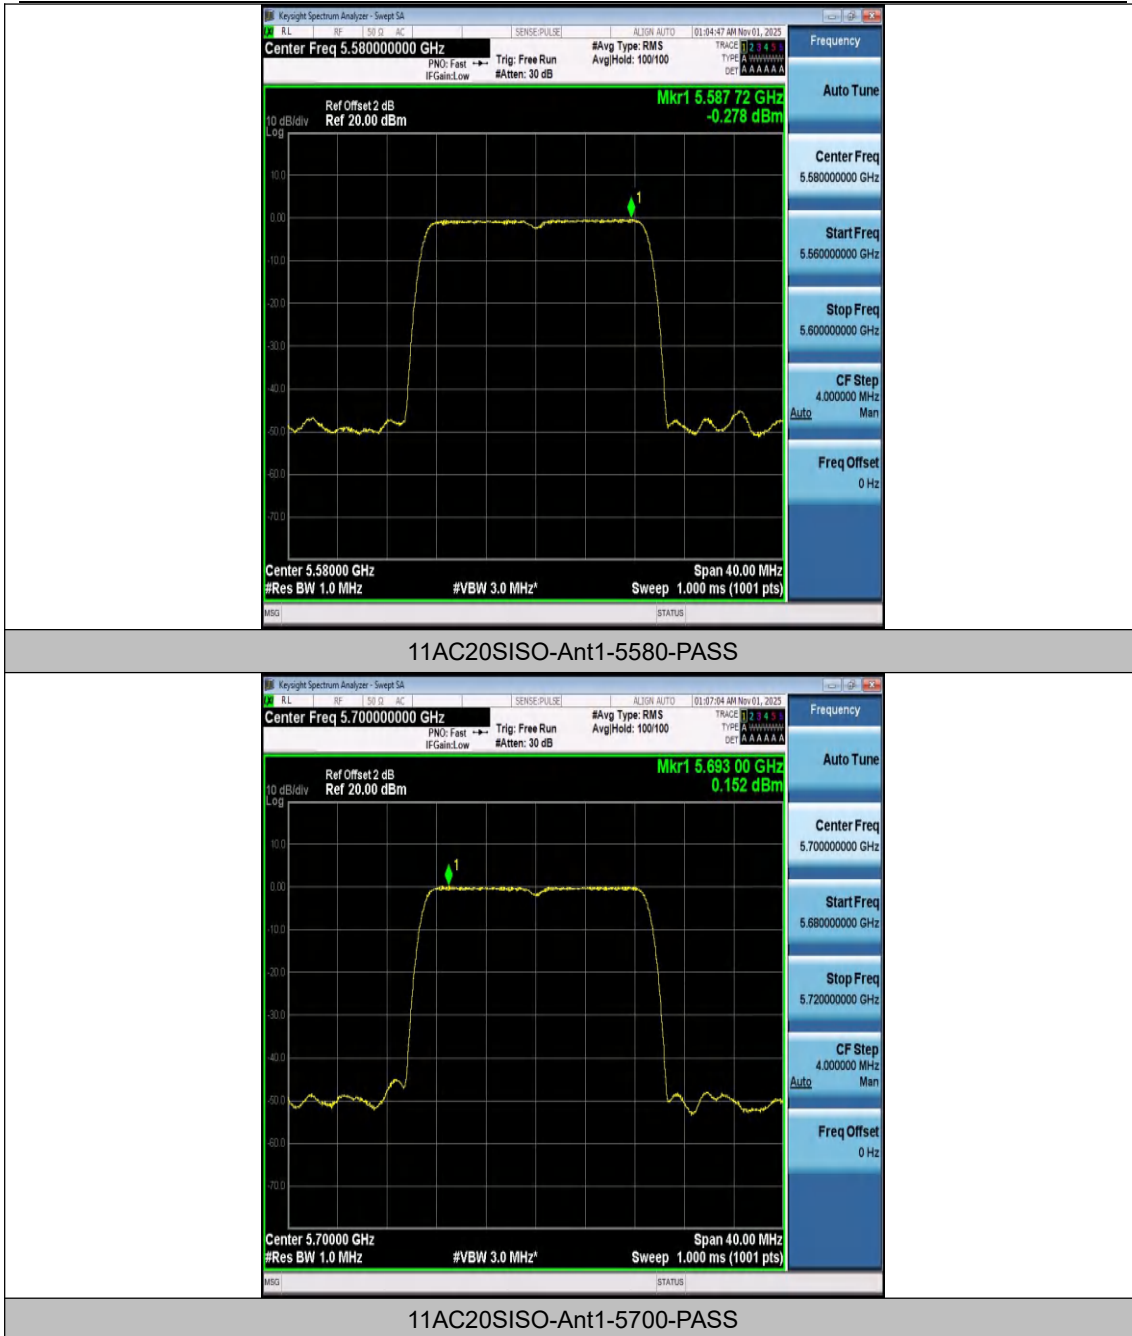

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

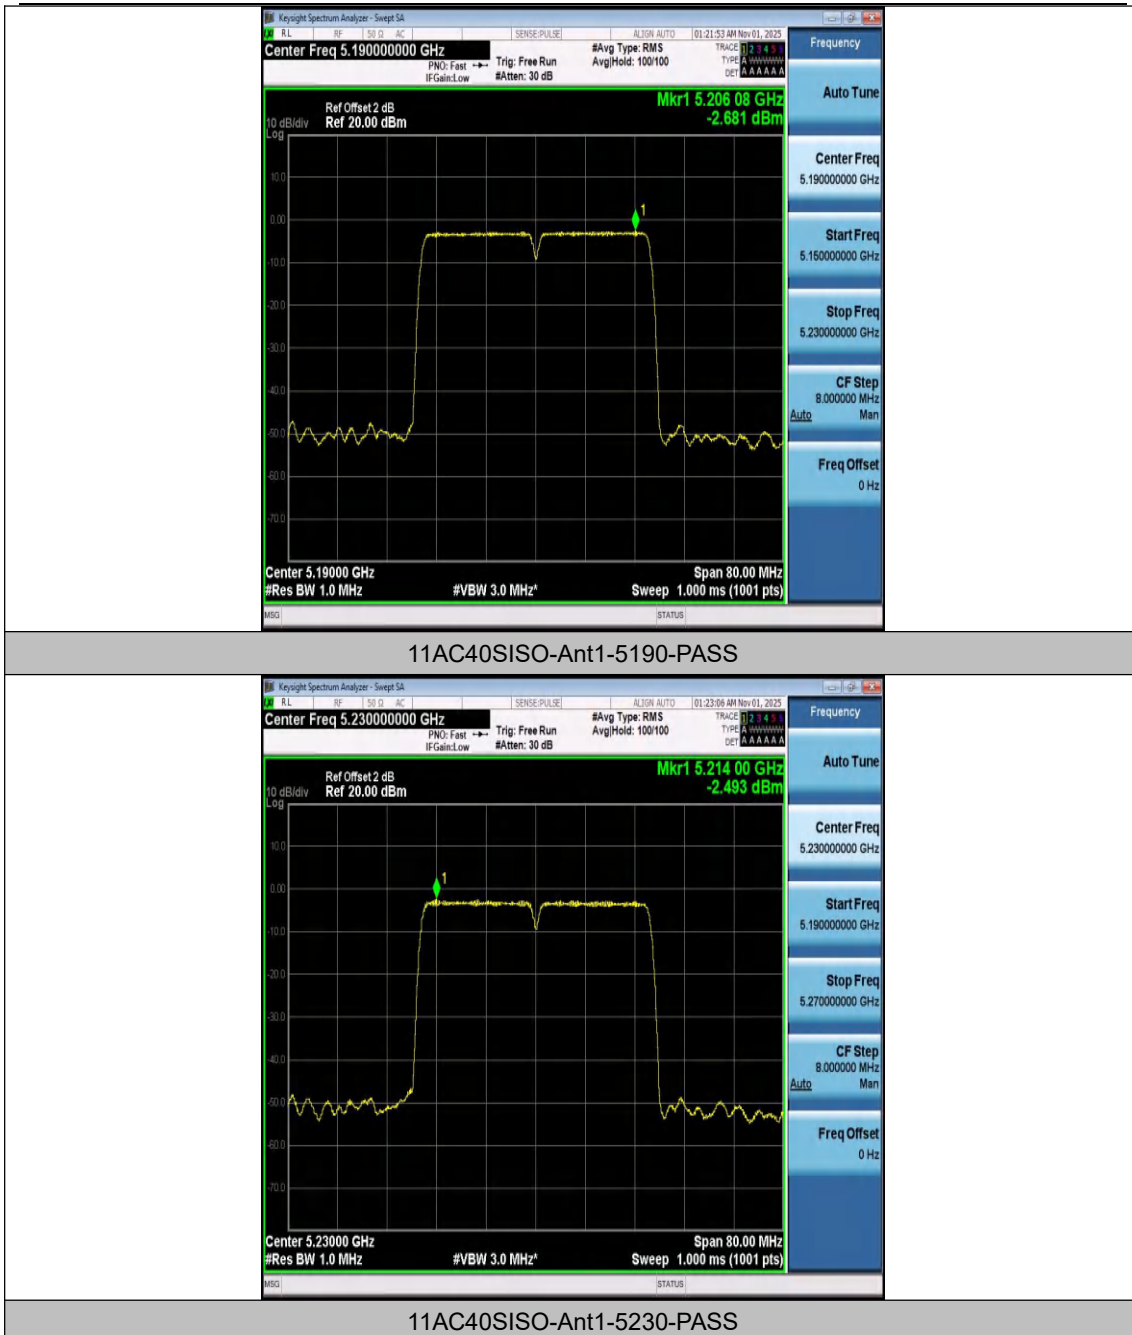

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

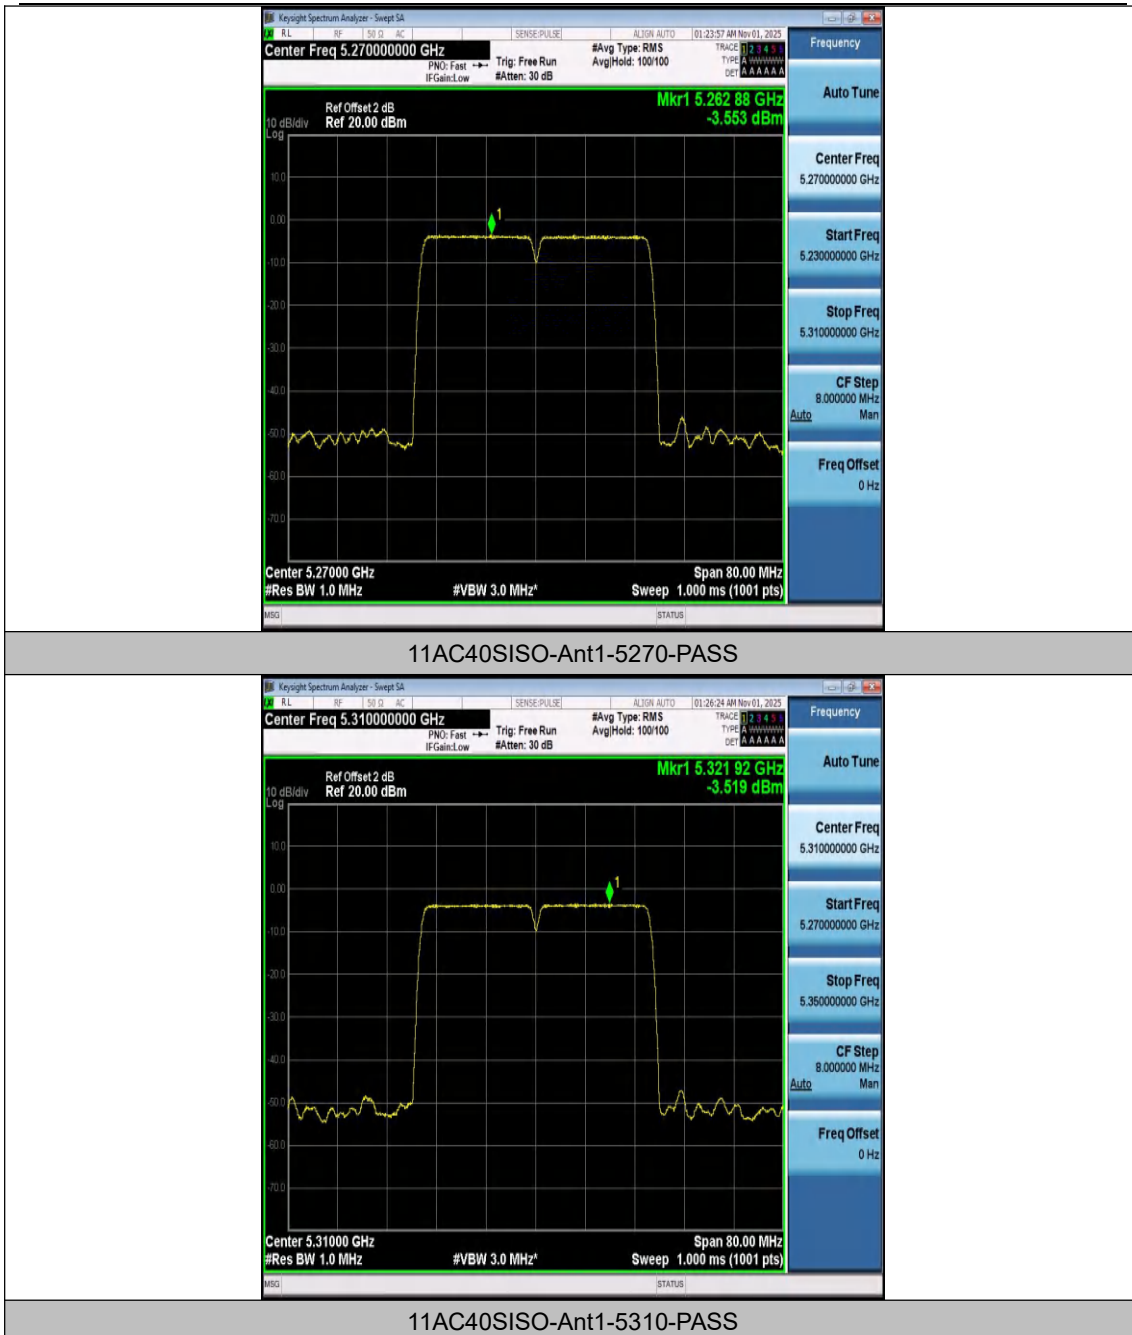

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com