

Appendix Test Data


Report No.:	1819C50096912502	Test Sample No.:	1-2-2
Start Test Date:	2025-8-25	Finish Test Date:	2025-9-4
Test Engineer:	Alex Peng	Auditor:	Justin Feng
Temperature:	25.7°C	Relative Humidity:	44%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	19.920	5170.000	5189.920	---	---
11A	Ant1	5220	19.680	5210.120	5229.800	---	---
11A	Ant1	5240	19.760	5230.160	5249.920	---	---
11A	Ant1	5745	19.840	5735.000	5754.840	---	---
11A	Ant1	5785	19.800	5775.280	5795.080	---	---
11A	Ant1	5825	19.880	5815.200	5835.080	---	---
11N20SISO	Ant1	5180	20.120	5169.920	5190.040	---	---
11N20SISO	Ant1	5220	20.240	5210.000	5230.240	---	---
11N20SISO	Ant1	5240	20.240	5229.920	5250.160	---	---
11N20SISO	Ant1	5745	20.240	5734.920	5755.160	---	---
11N20SISO	Ant1	5785	20.280	5774.880	5795.160	---	---
11N20SISO	Ant1	5825	20.360	5814.760	5835.120	---	---
11N40SISO	Ant1	5190	40.160	5170.080	5210.240	---	---
11N40SISO	Ant1	5230	40.560	5209.600	5250.160	---	---
11N40SISO	Ant1	5755	40.560	5734.680	5775.240	---	---
11N40SISO	Ant1	5795	40.720	5774.600	5815.320	---	---


Test Graphs

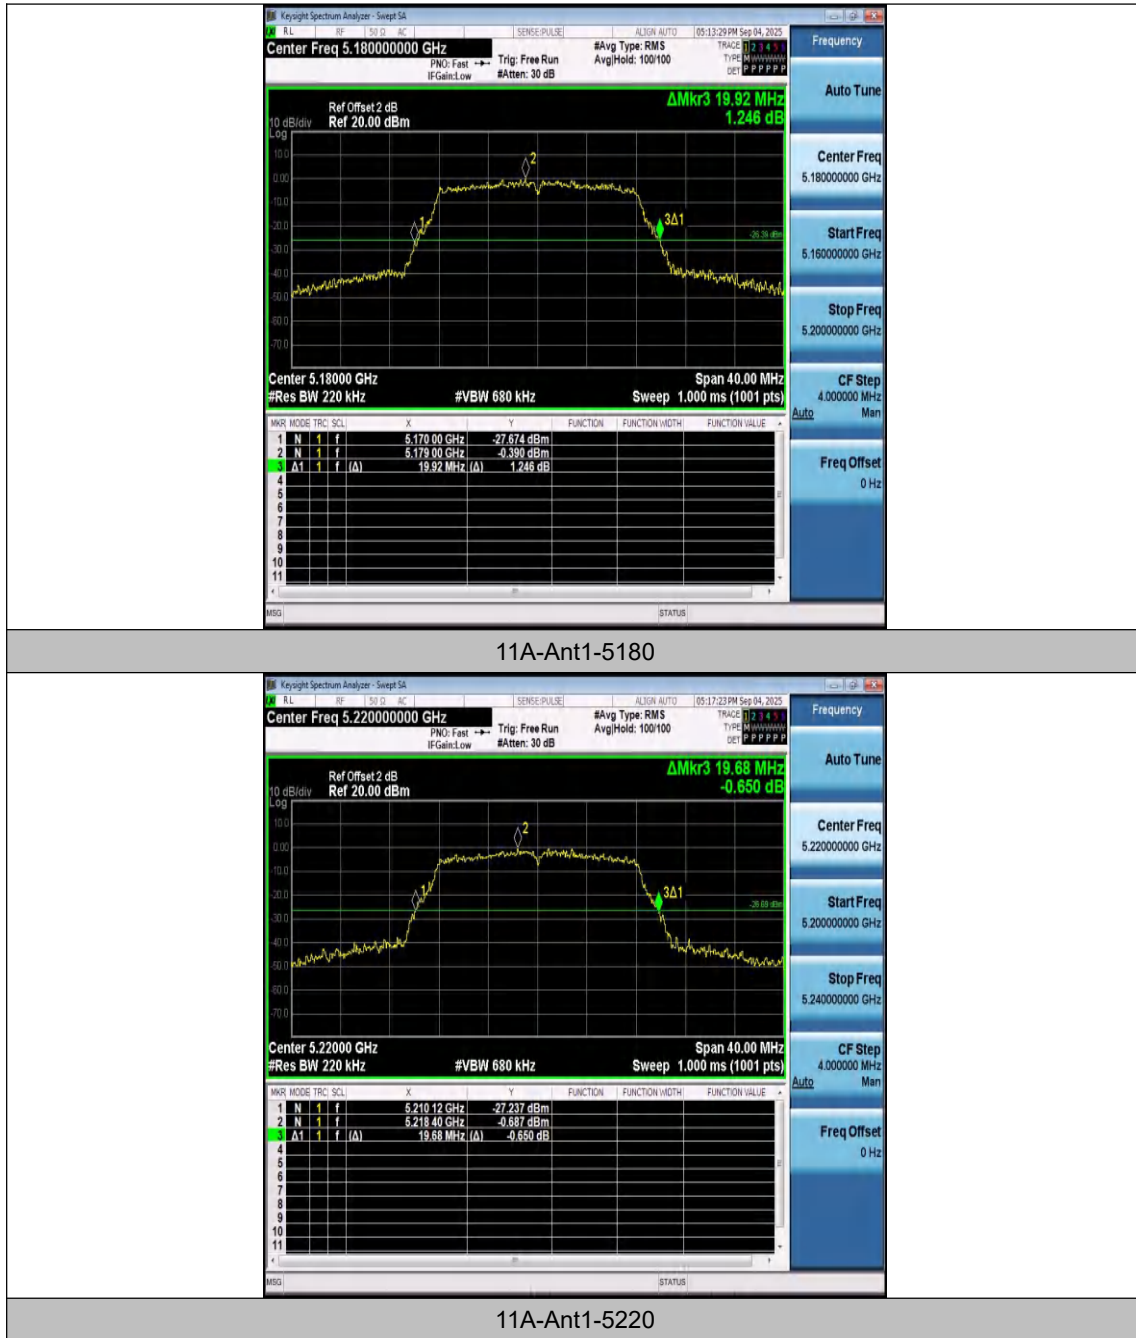

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

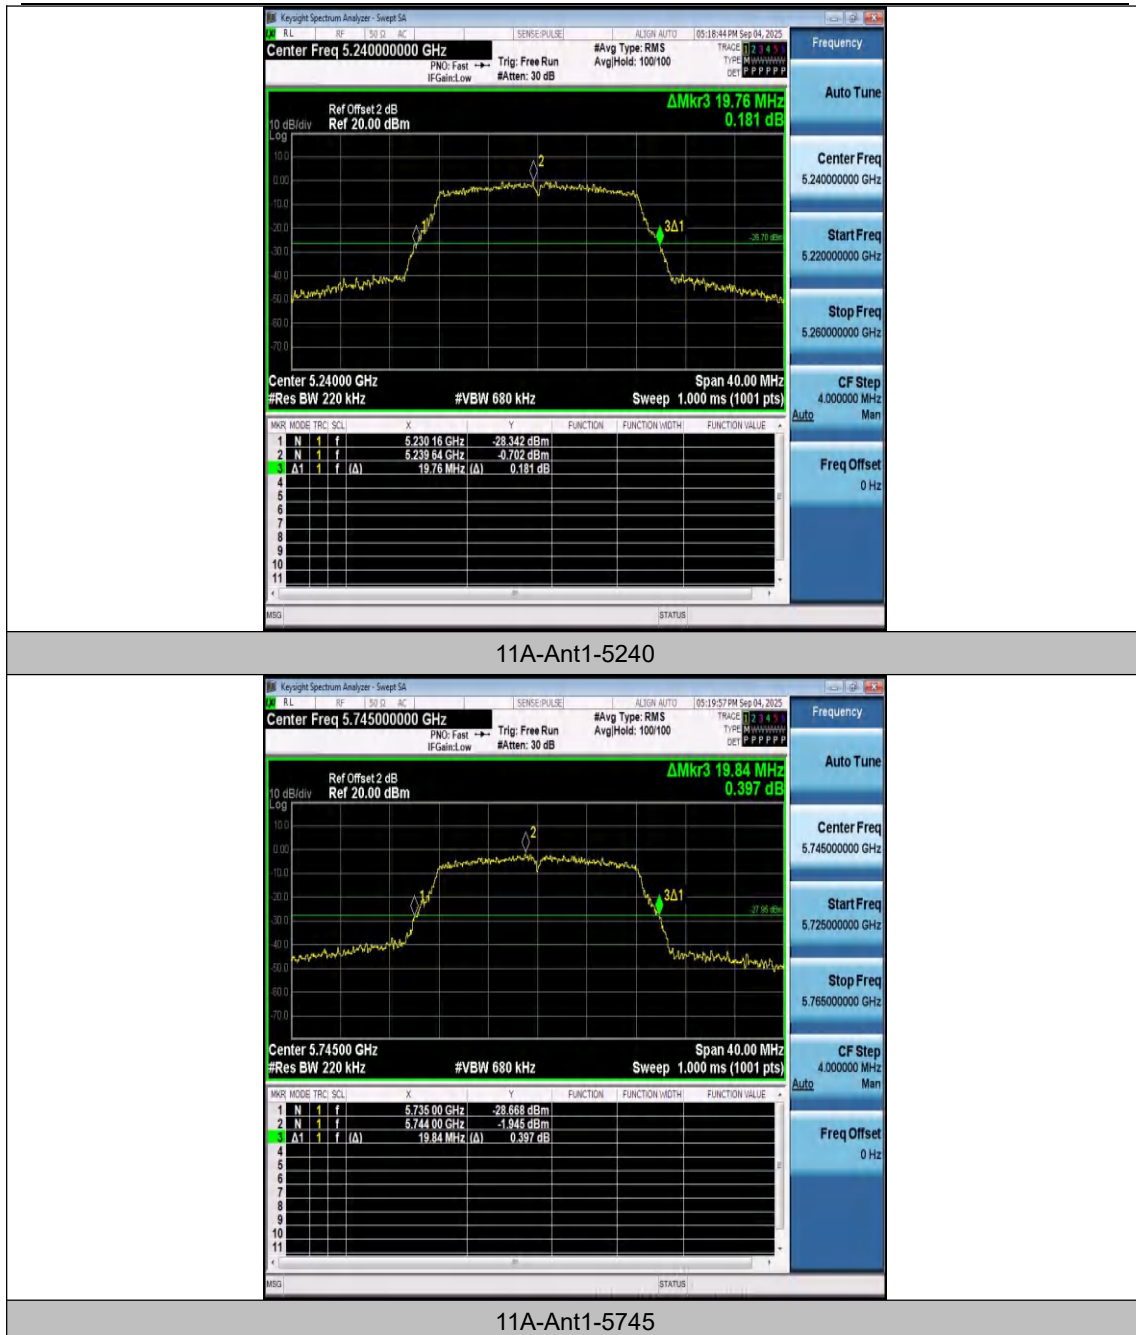


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

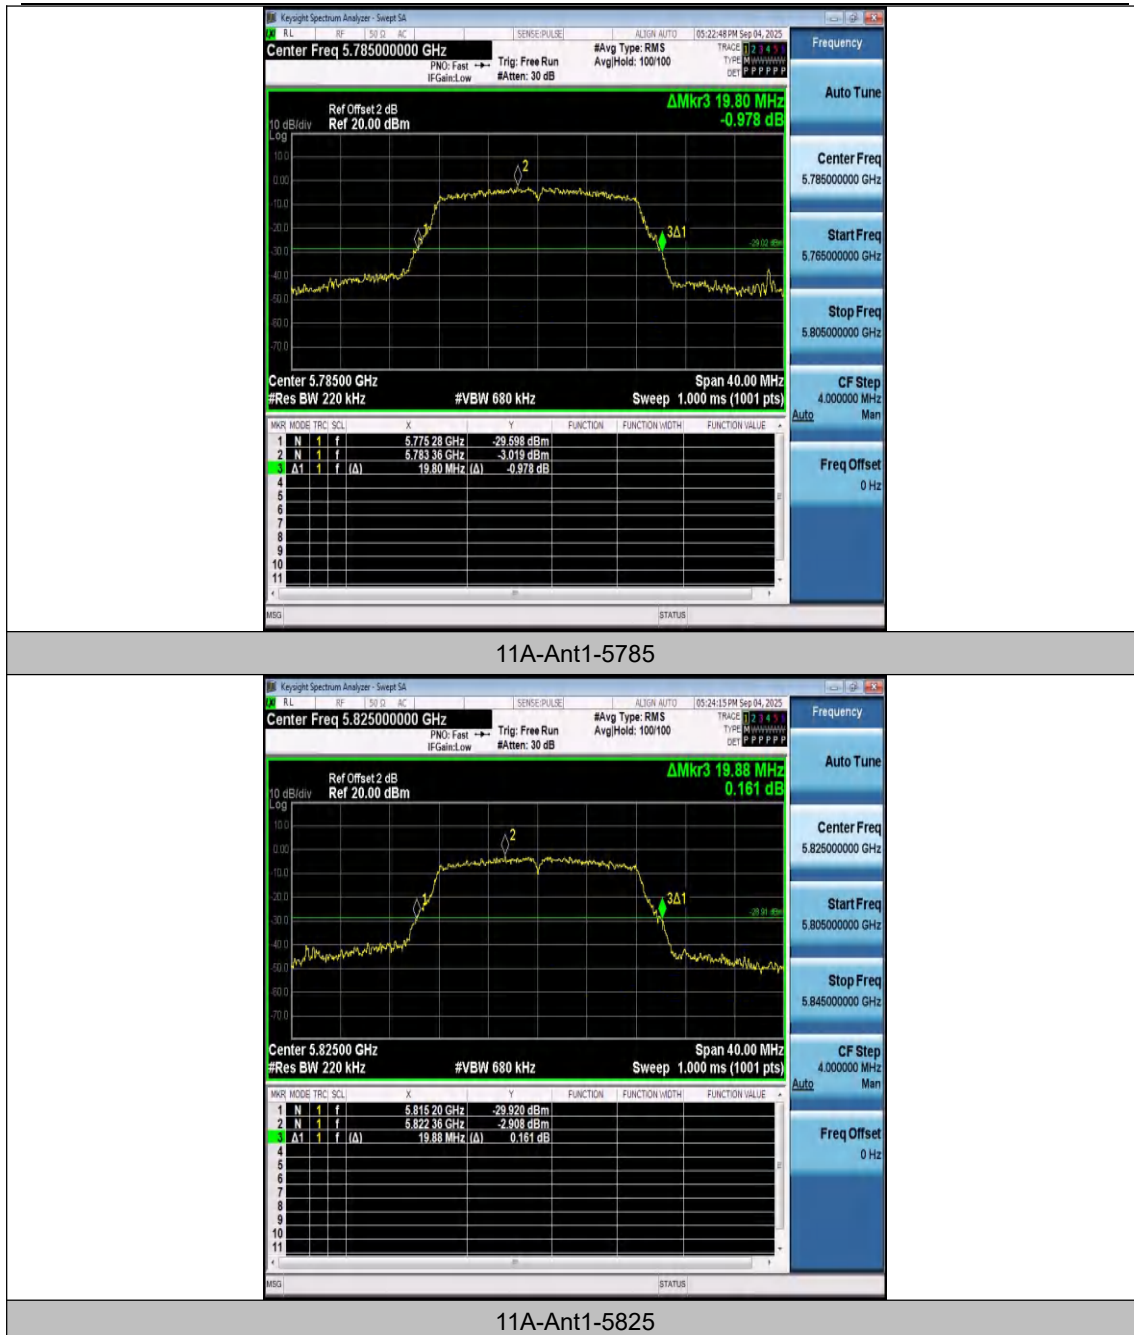


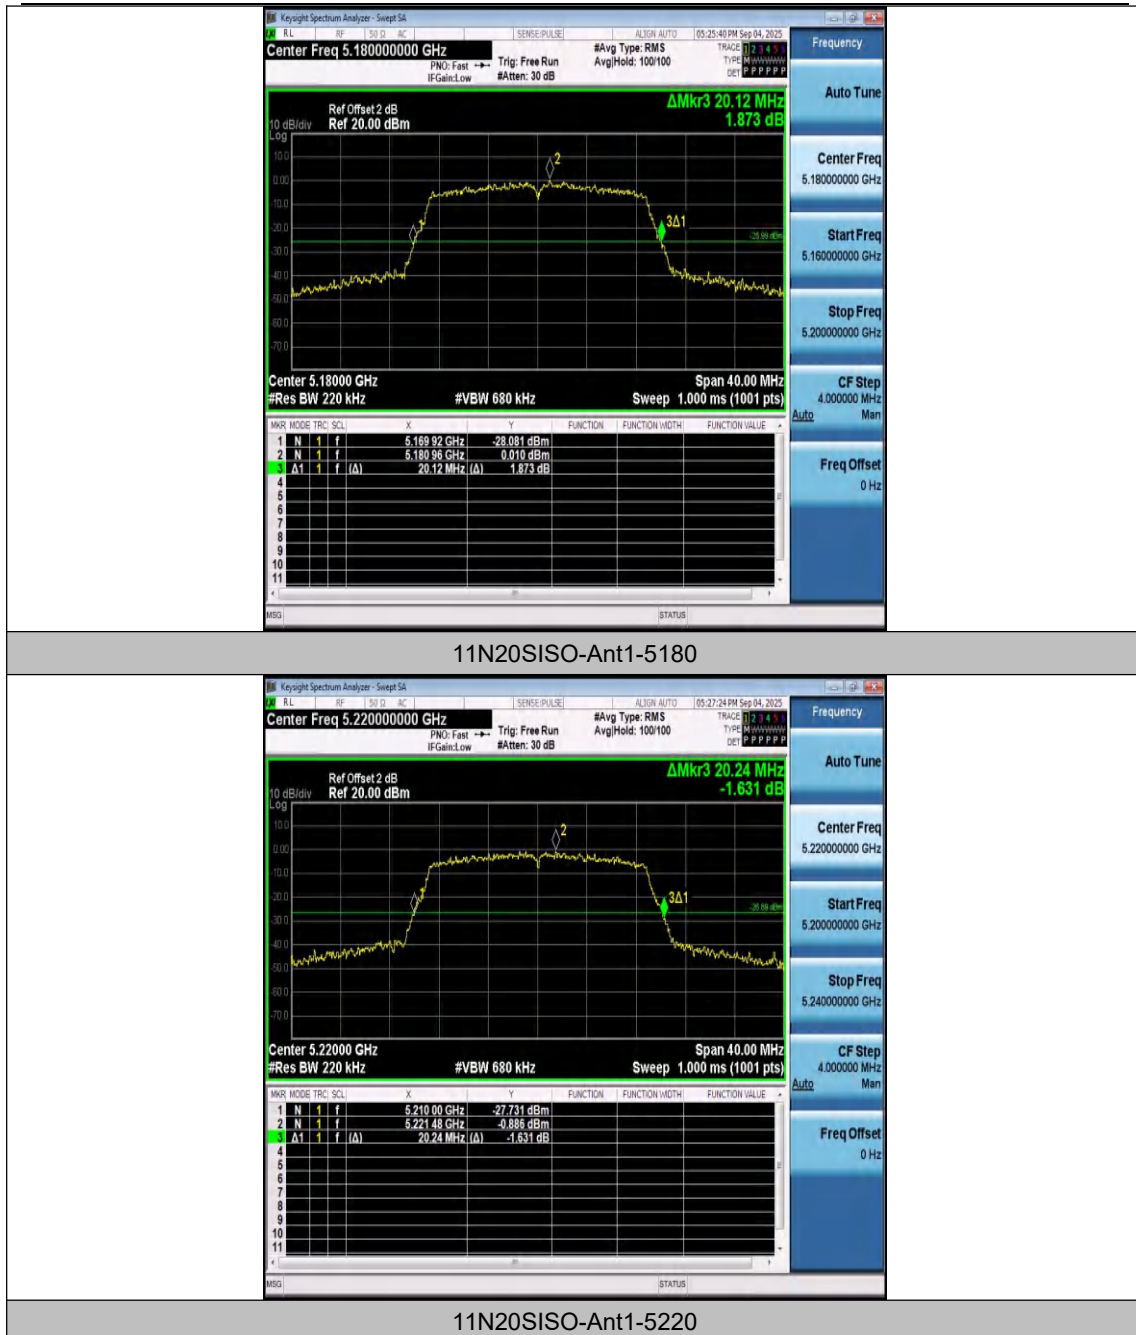

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

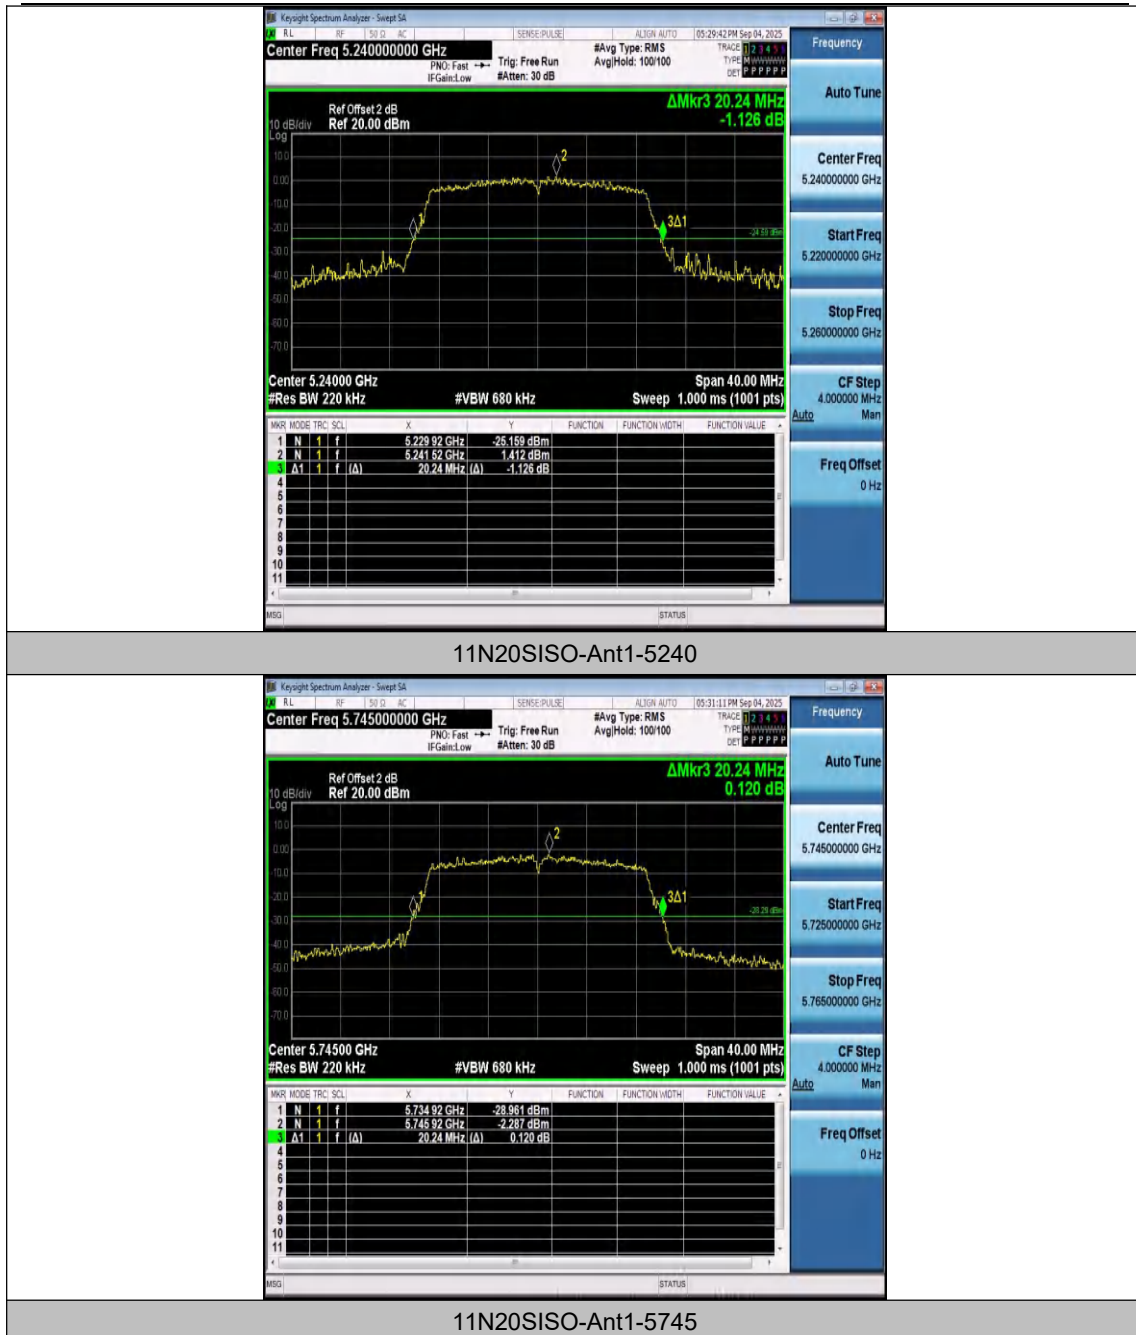

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

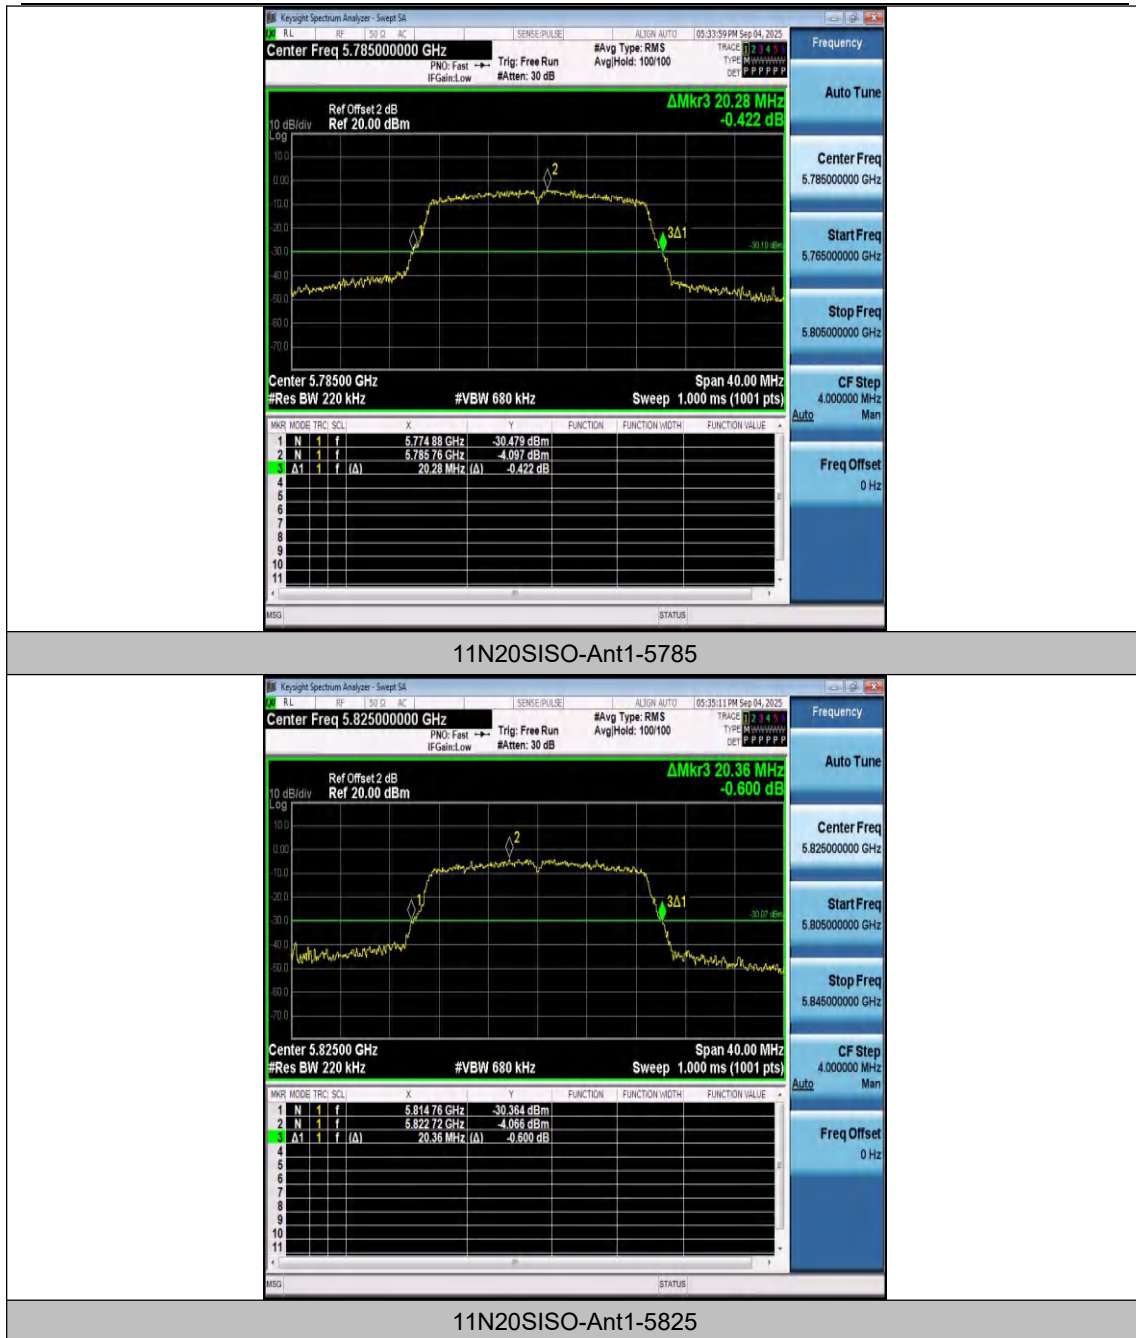


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

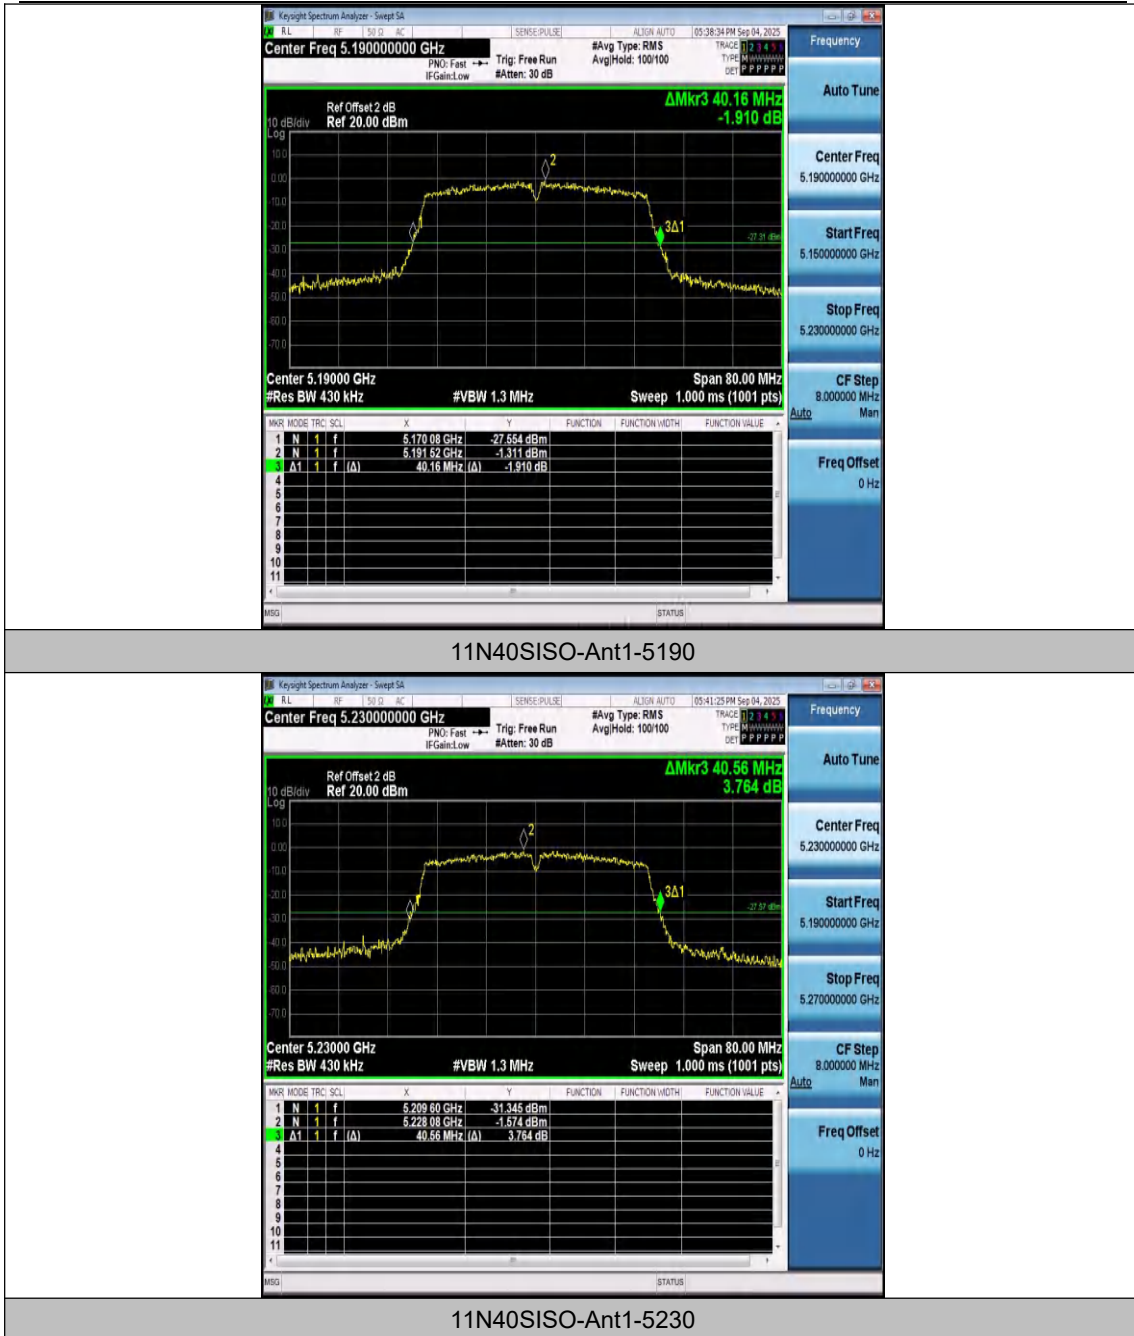

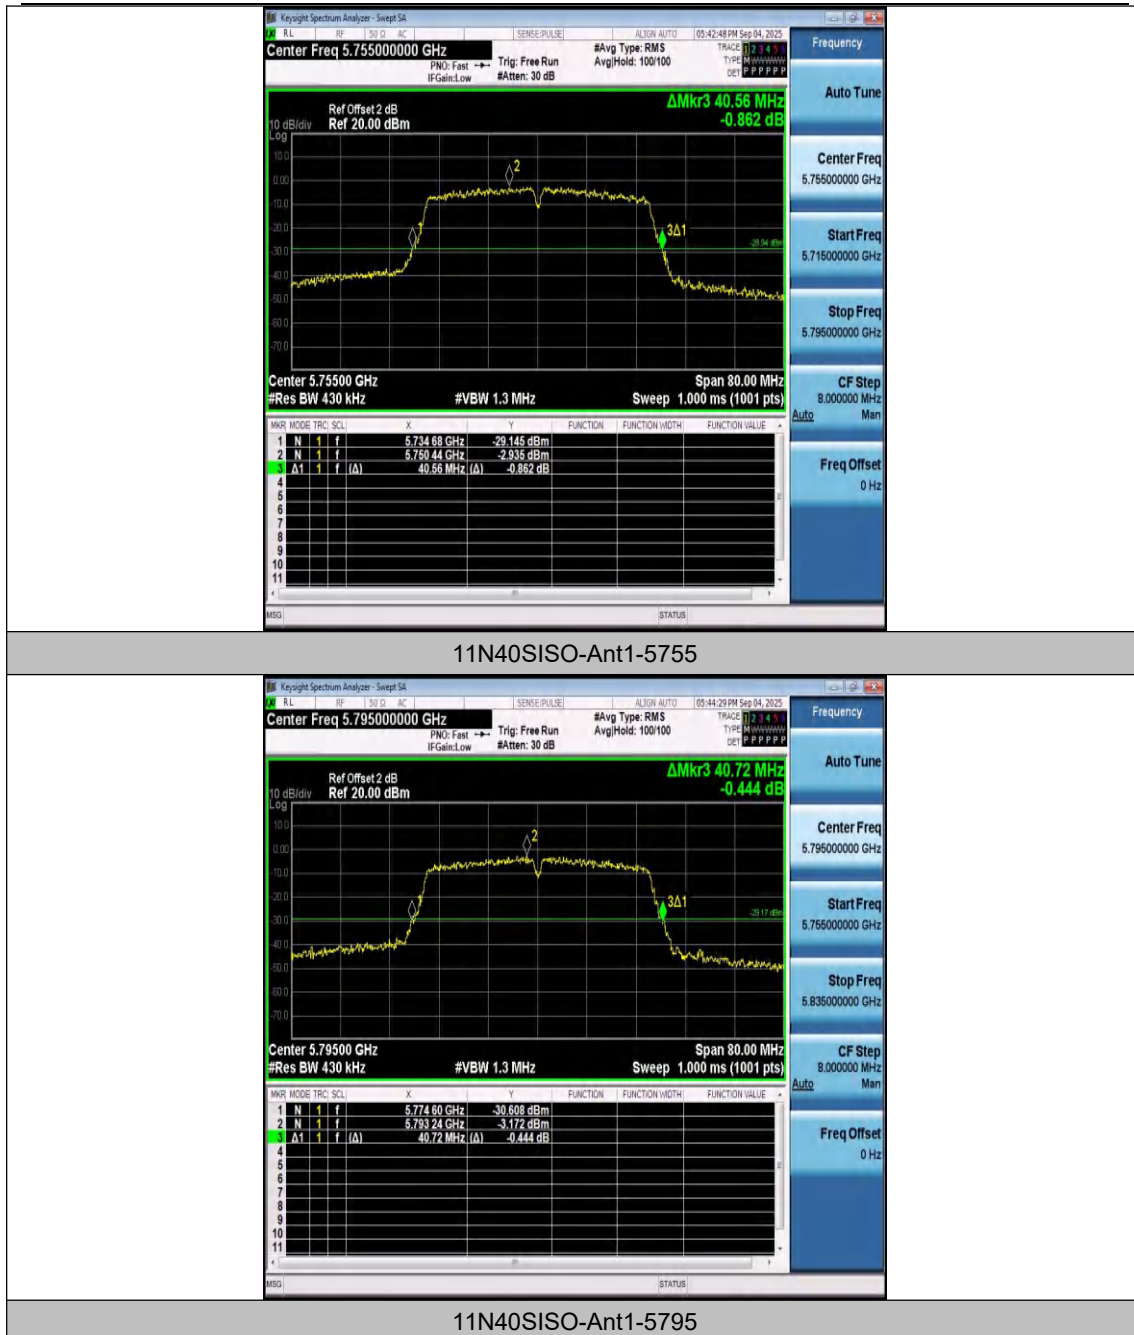

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.753	5171.6680	5188.4210	---	---
11A	Ant1	5220	16.874	5211.5785	5228.4525	---	---
11A	Ant1	5240	16.849	5231.5611	5248.4101	---	---
11A	Ant1	5745	16.785	5736.6427	5753.4277	---	---
11A	Ant1	5785	16.872	5776.5893	5793.4613	---	---
11A	Ant1	5825	16.777	5816.6599	5833.4369	---	---
11N20SISO	Ant1	5180	17.768	5171.1699	5188.9379	---	---
11N20SISO	Ant1	5220	17.769	5211.1124	5228.8814	---	---
11N20SISO	Ant1	5240	17.780	5231.1421	5248.9221	---	---
11N20SISO	Ant1	5745	17.823	5736.1054	5753.9284	---	---
11N20SISO	Ant1	5785	17.802	5776.1171	5793.9191	---	---
11N20SISO	Ant1	5825	17.833	5816.0950	5833.9280	---	---
11N40SISO	Ant1	5190	35.980	5172.0908	5208.0708	---	---
11N40SISO	Ant1	5230	36.066	5211.9922	5248.0582	---	---
11N40SISO	Ant1	5755	36.116	5736.9584	5773.0744	---	---
11N40SISO	Ant1	5795	36.063	5776.9896	5813.0526	---	---


Test Graphs

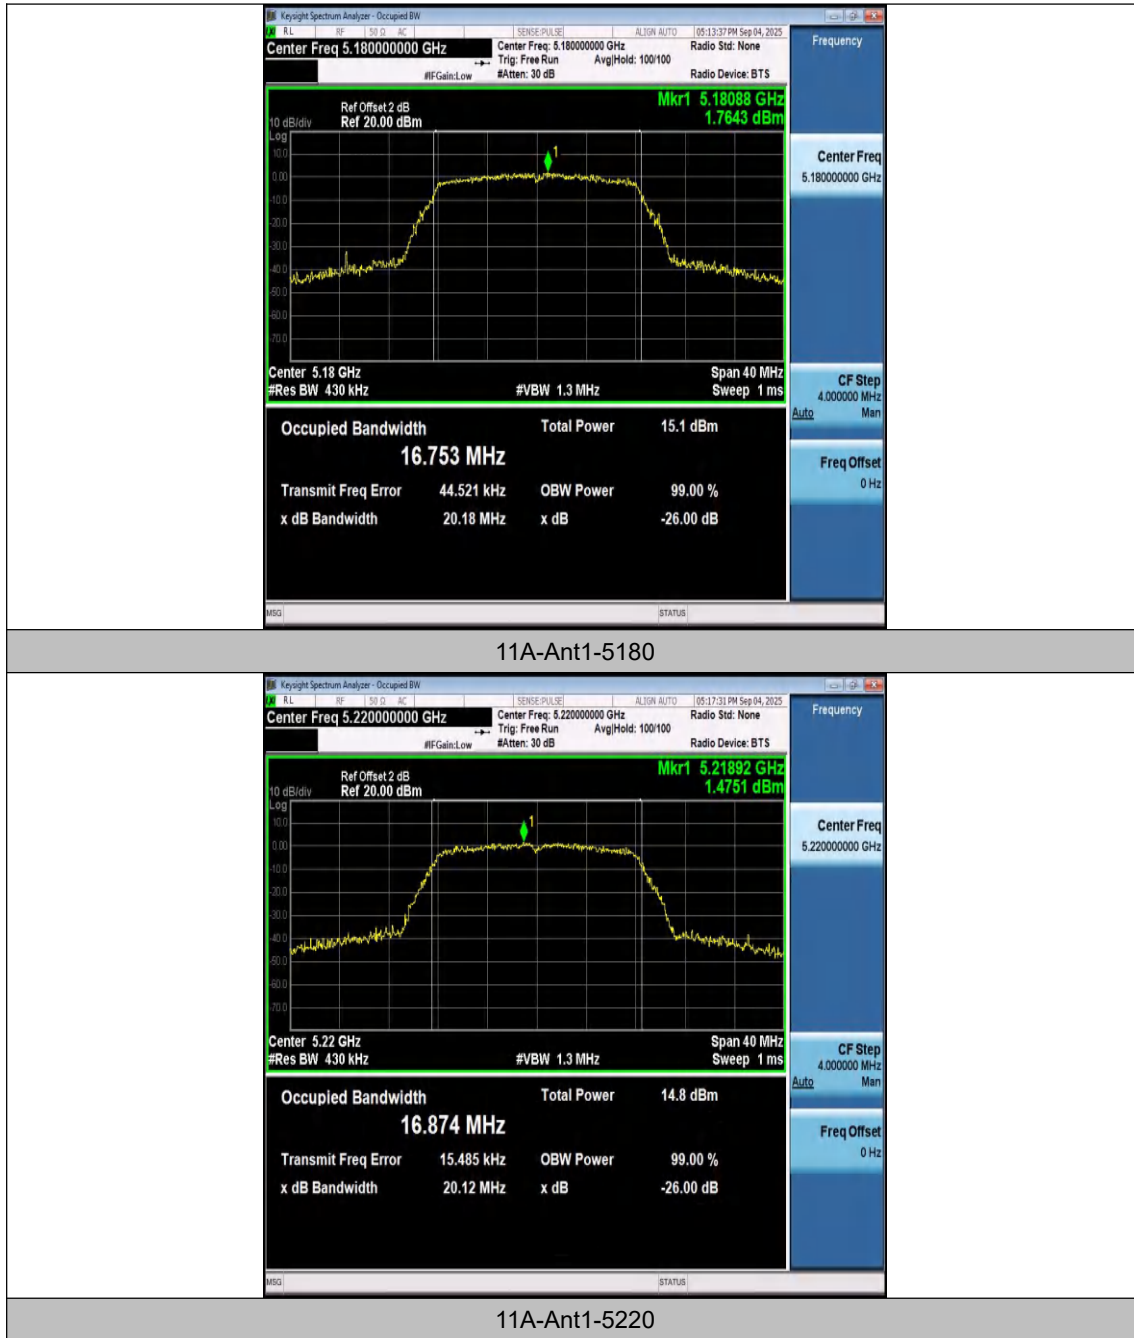

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

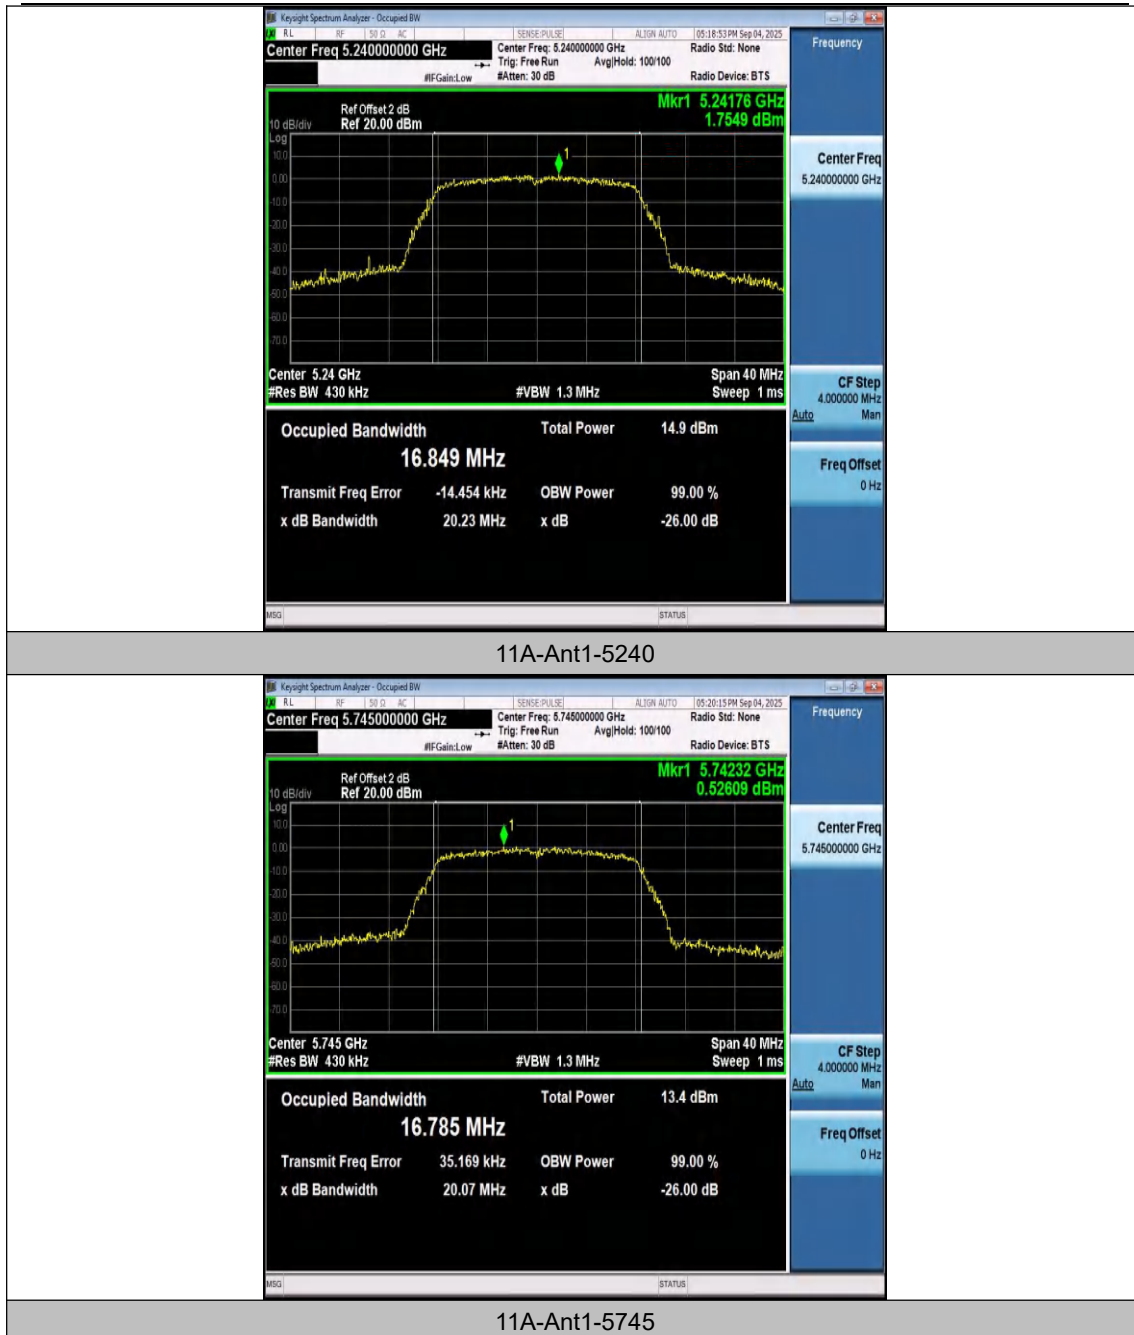


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

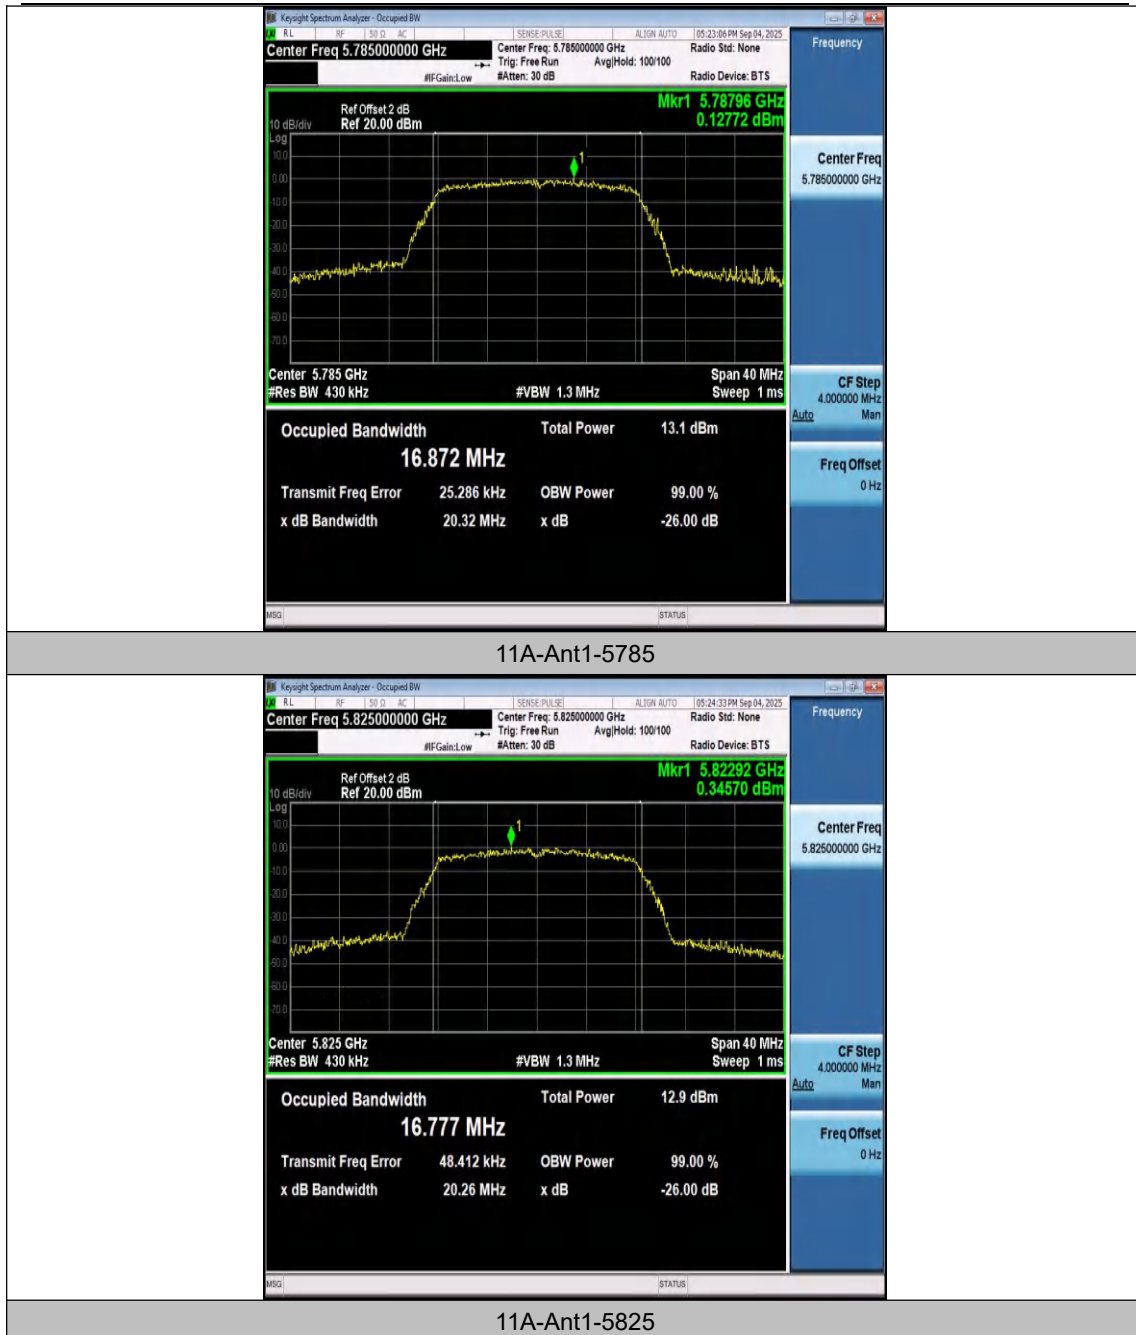


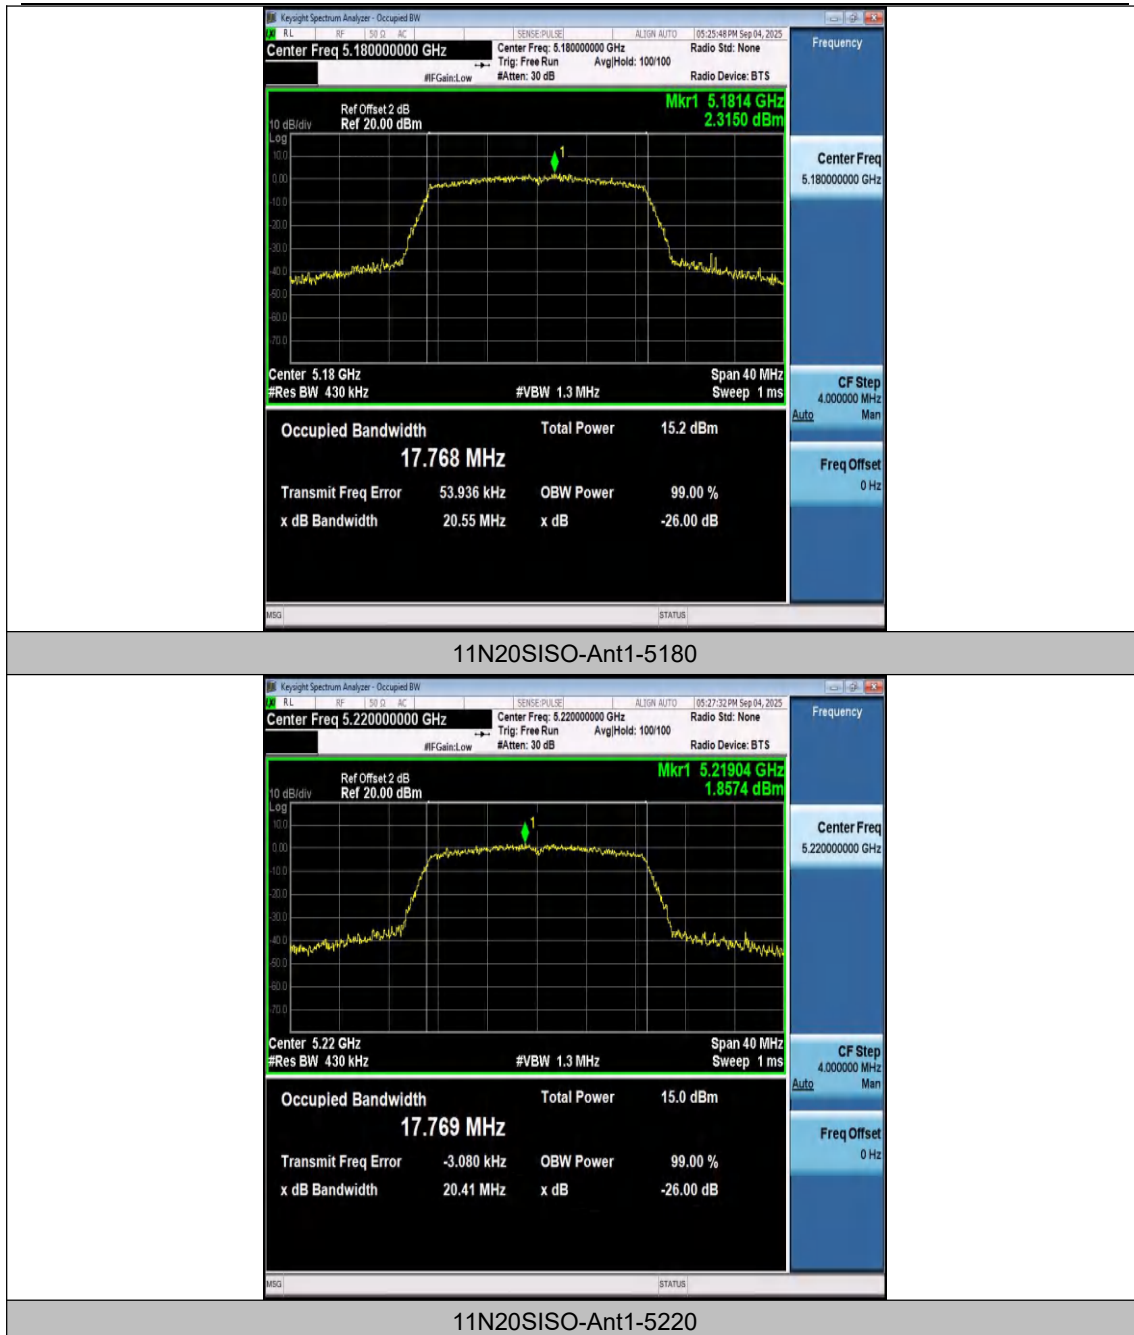

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

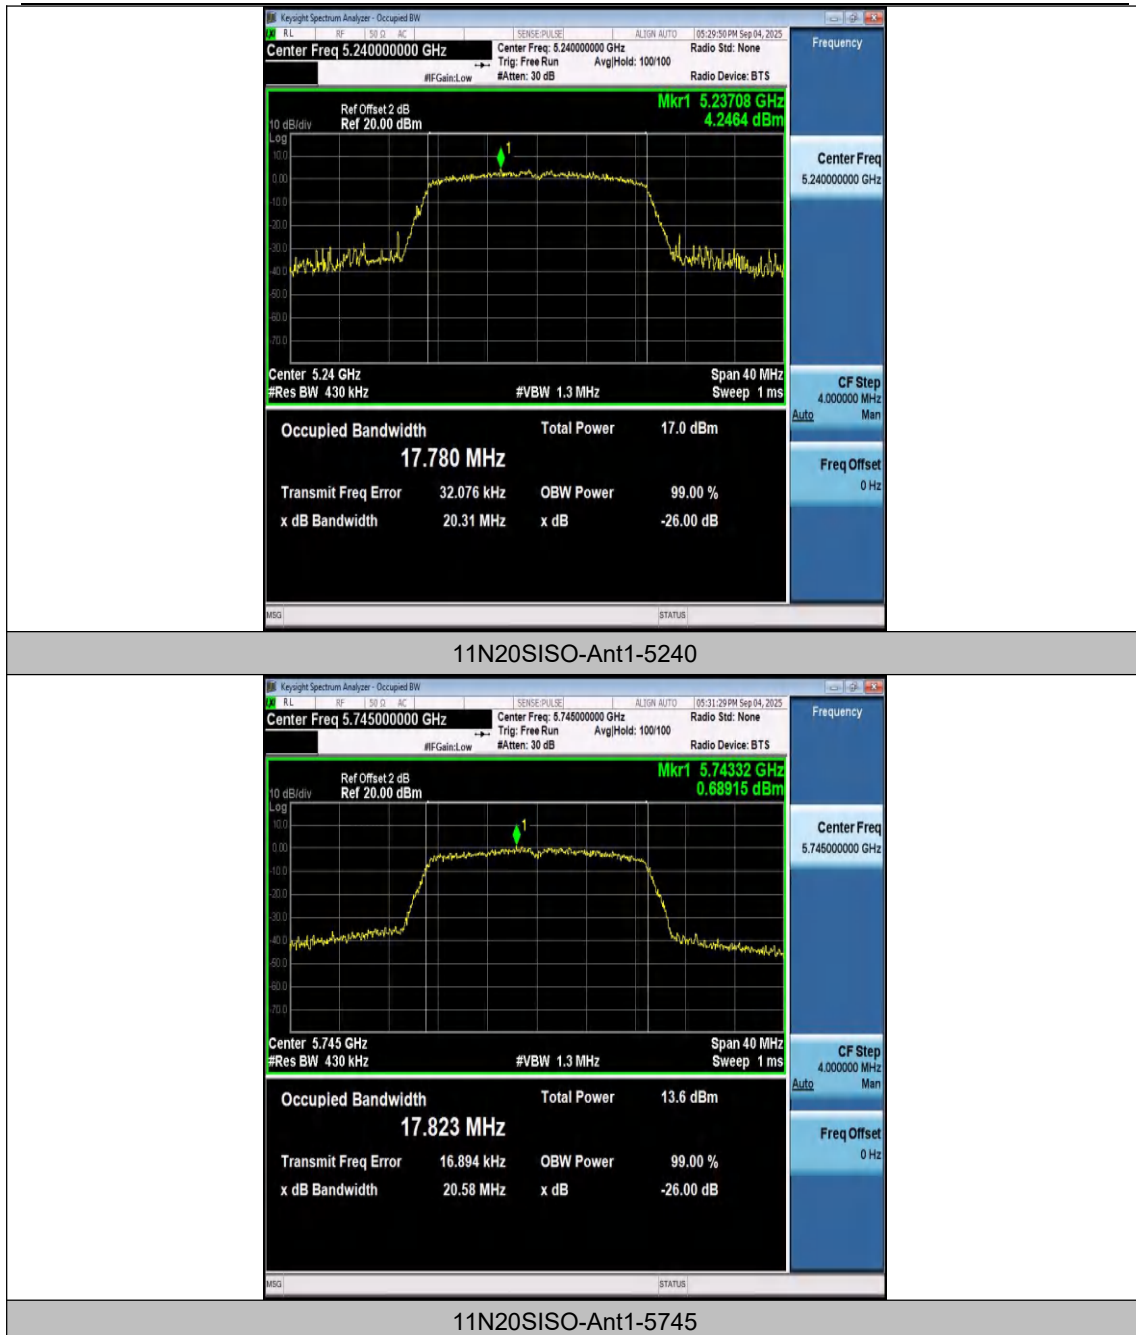

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

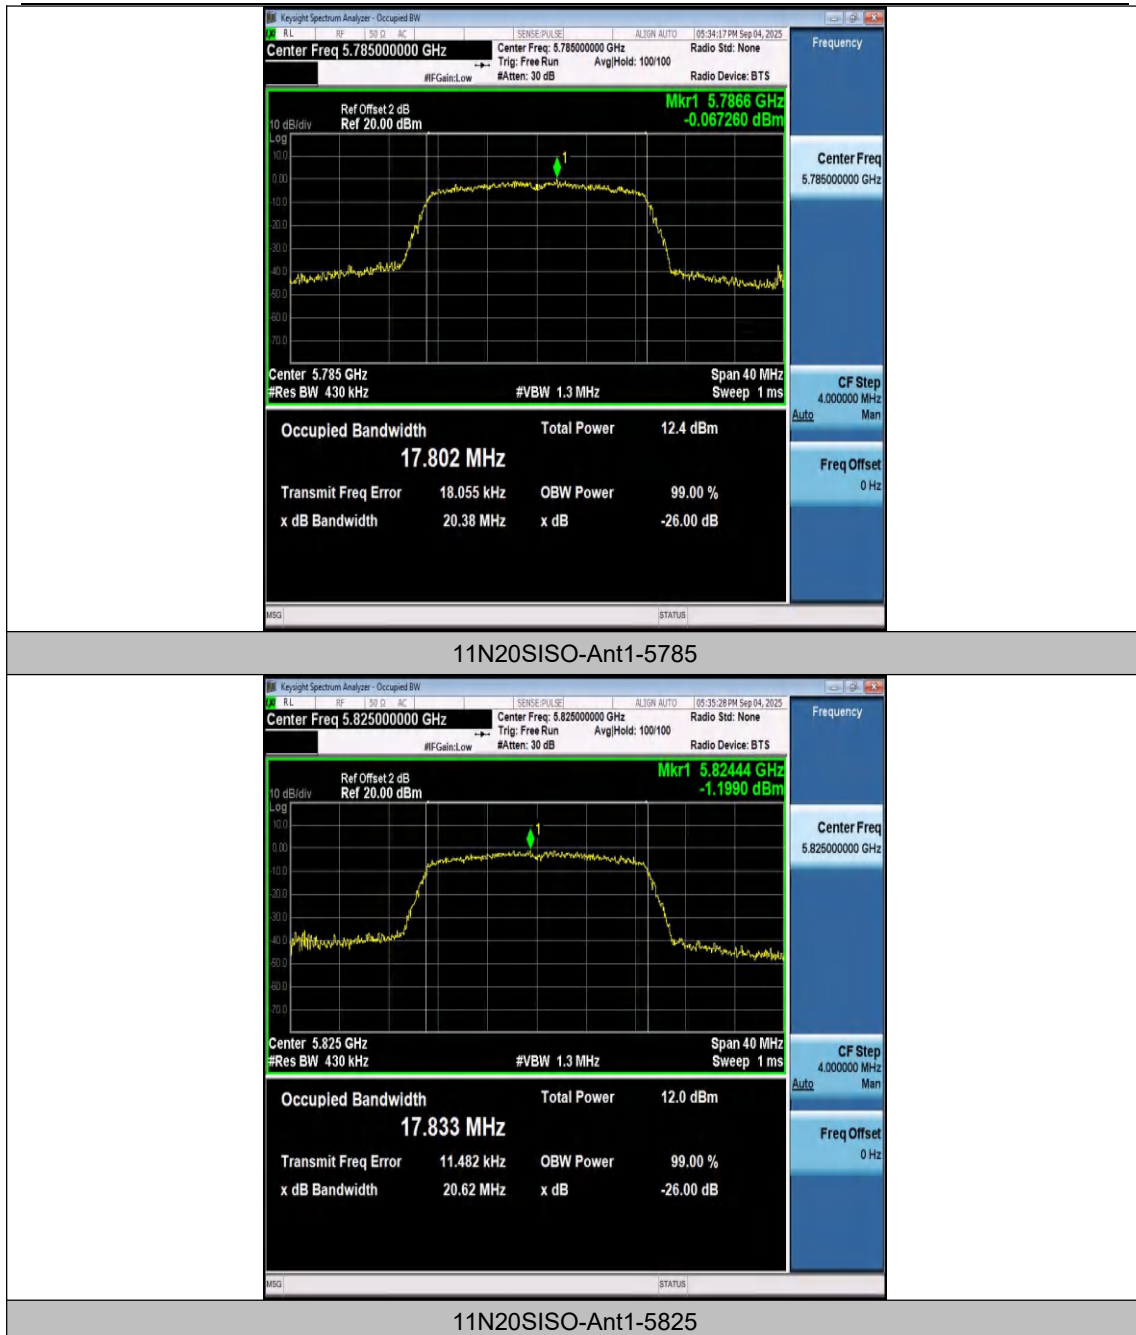

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

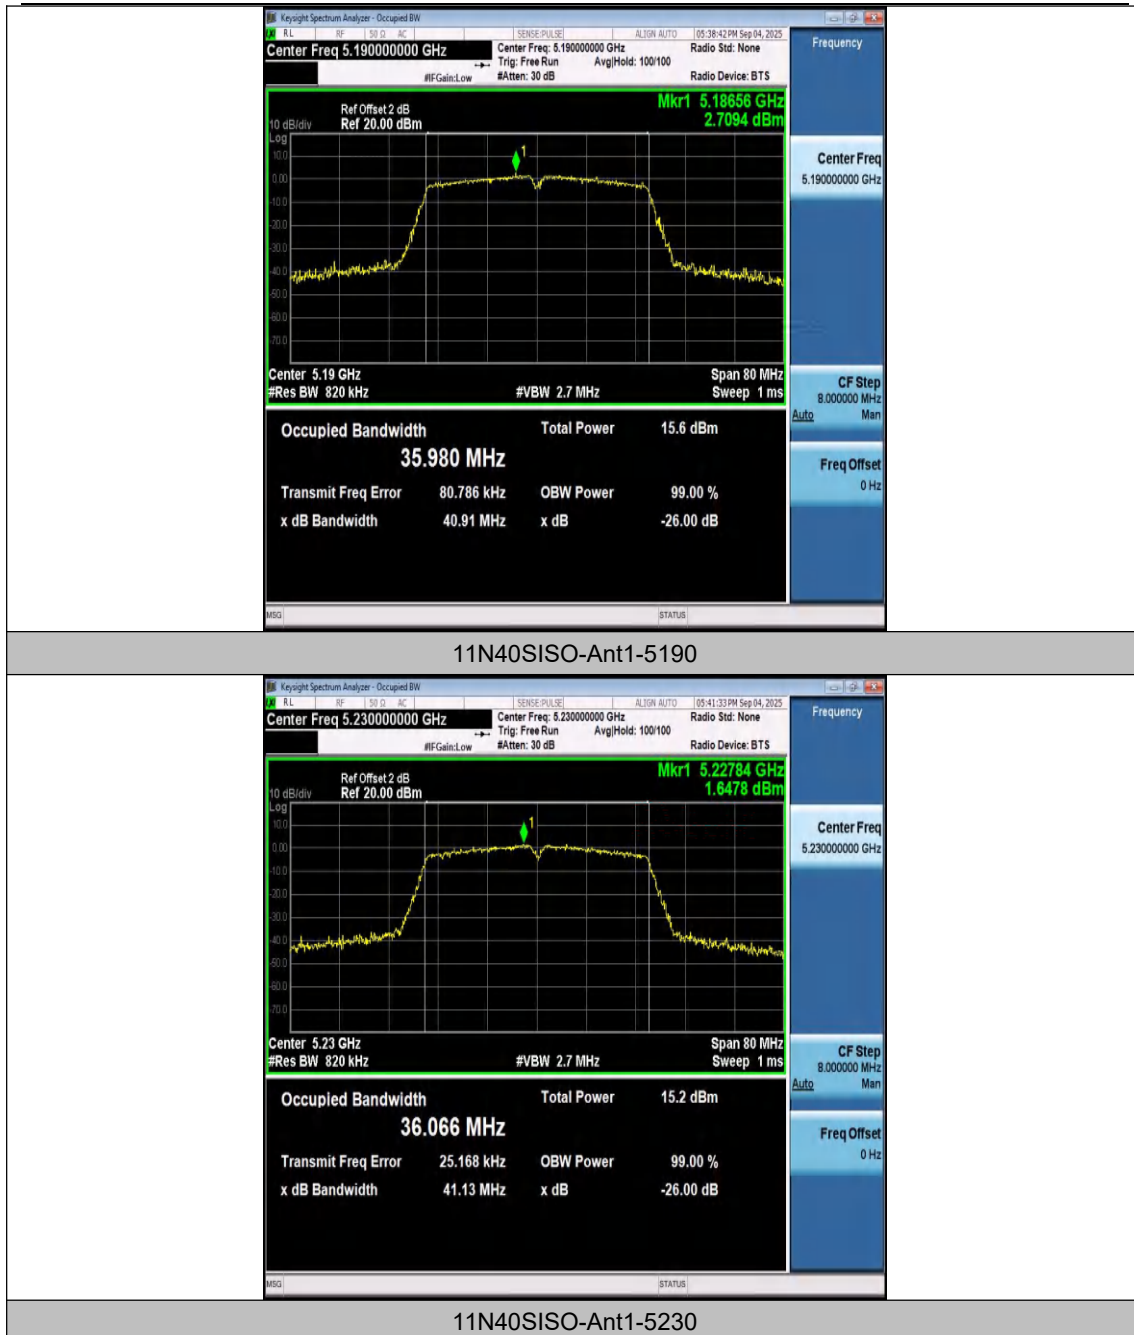

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

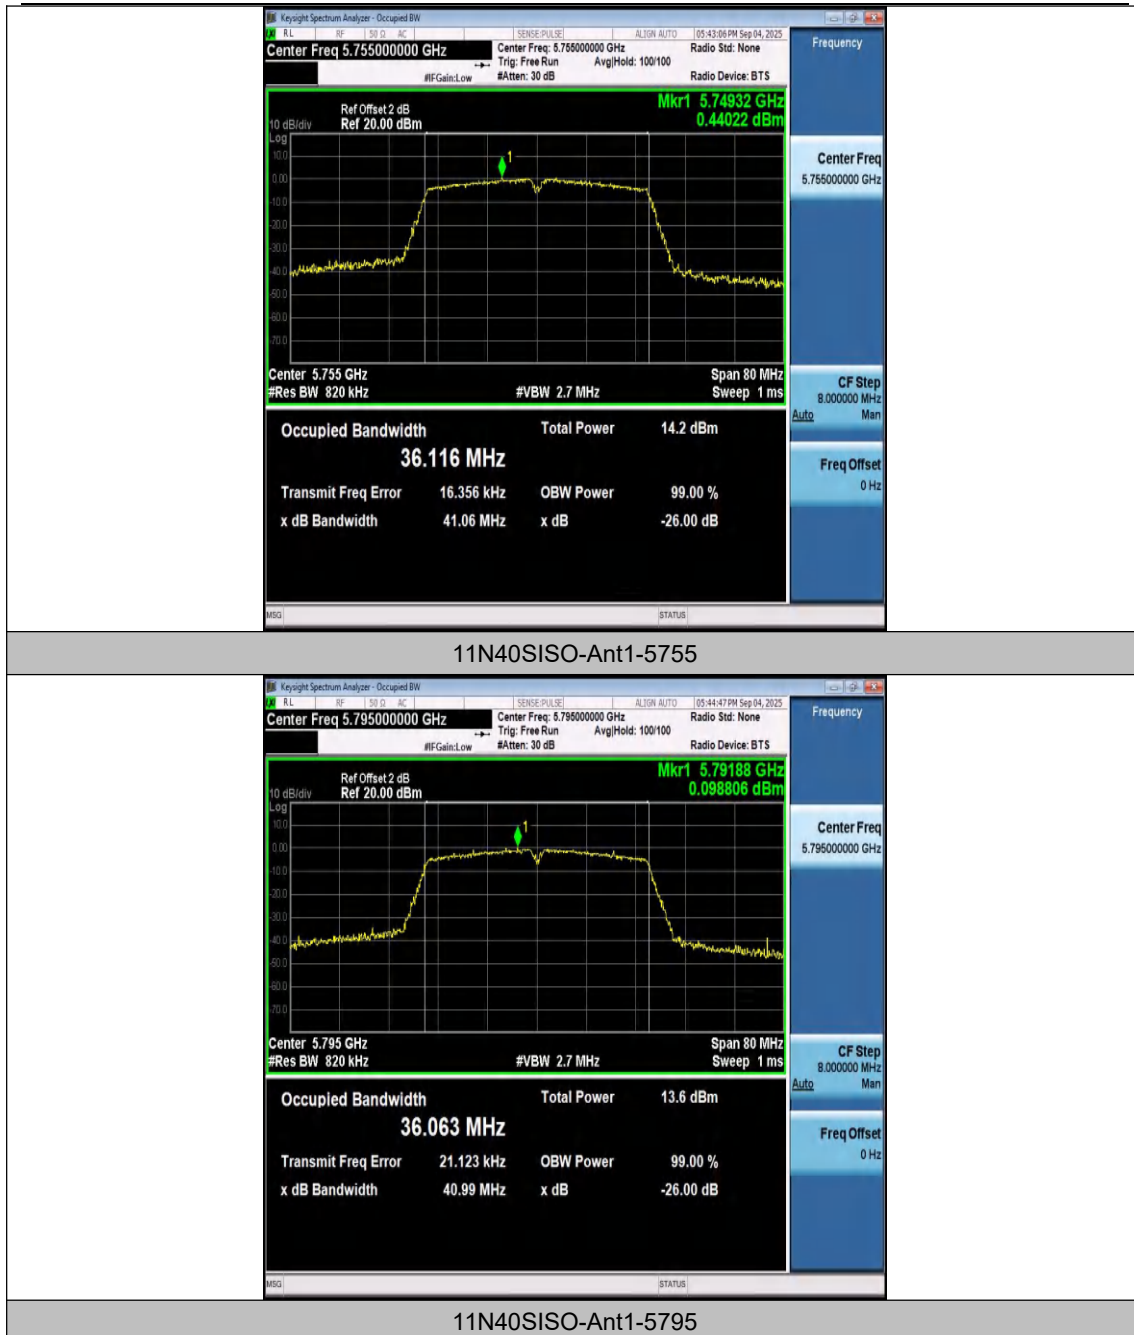

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix A3: Minimum 6dB Bandwidth**Test Result B4**


Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.320	5736.840	5753.160	0.5	PASS
11A	Ant1	5785	16.320	5776.840	5793.160	0.5	PASS
11A	Ant1	5825	16.360	5816.840	5833.200	0.5	PASS
11N20SISO	Ant1	5745	17.320	5736.240	5753.560	0.5	PASS
11N20SISO	Ant1	5785	17.600	5776.200	5793.800	0.5	PASS
11N20SISO	Ant1	5825	17.520	5816.240	5833.760	0.5	PASS
11N40SISO	Ant1	5755	35.680	5736.840	5772.520	0.5	PASS
11N40SISO	Ant1	5795	36.000	5776.920	5812.920	0.5	PASS

Test Graphs B4

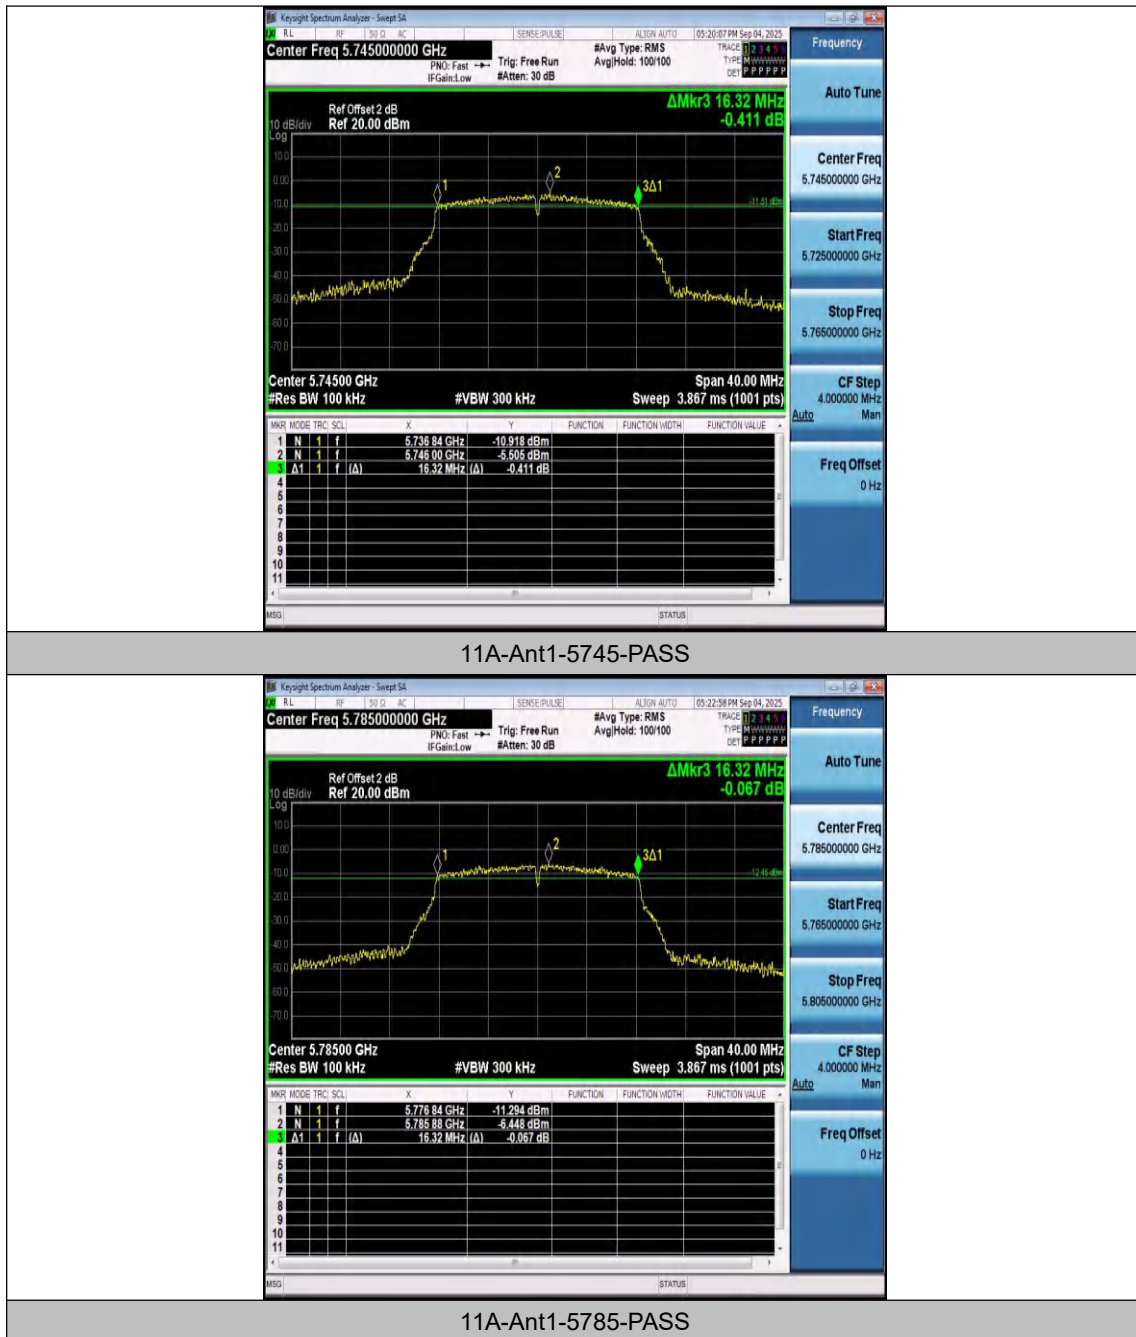

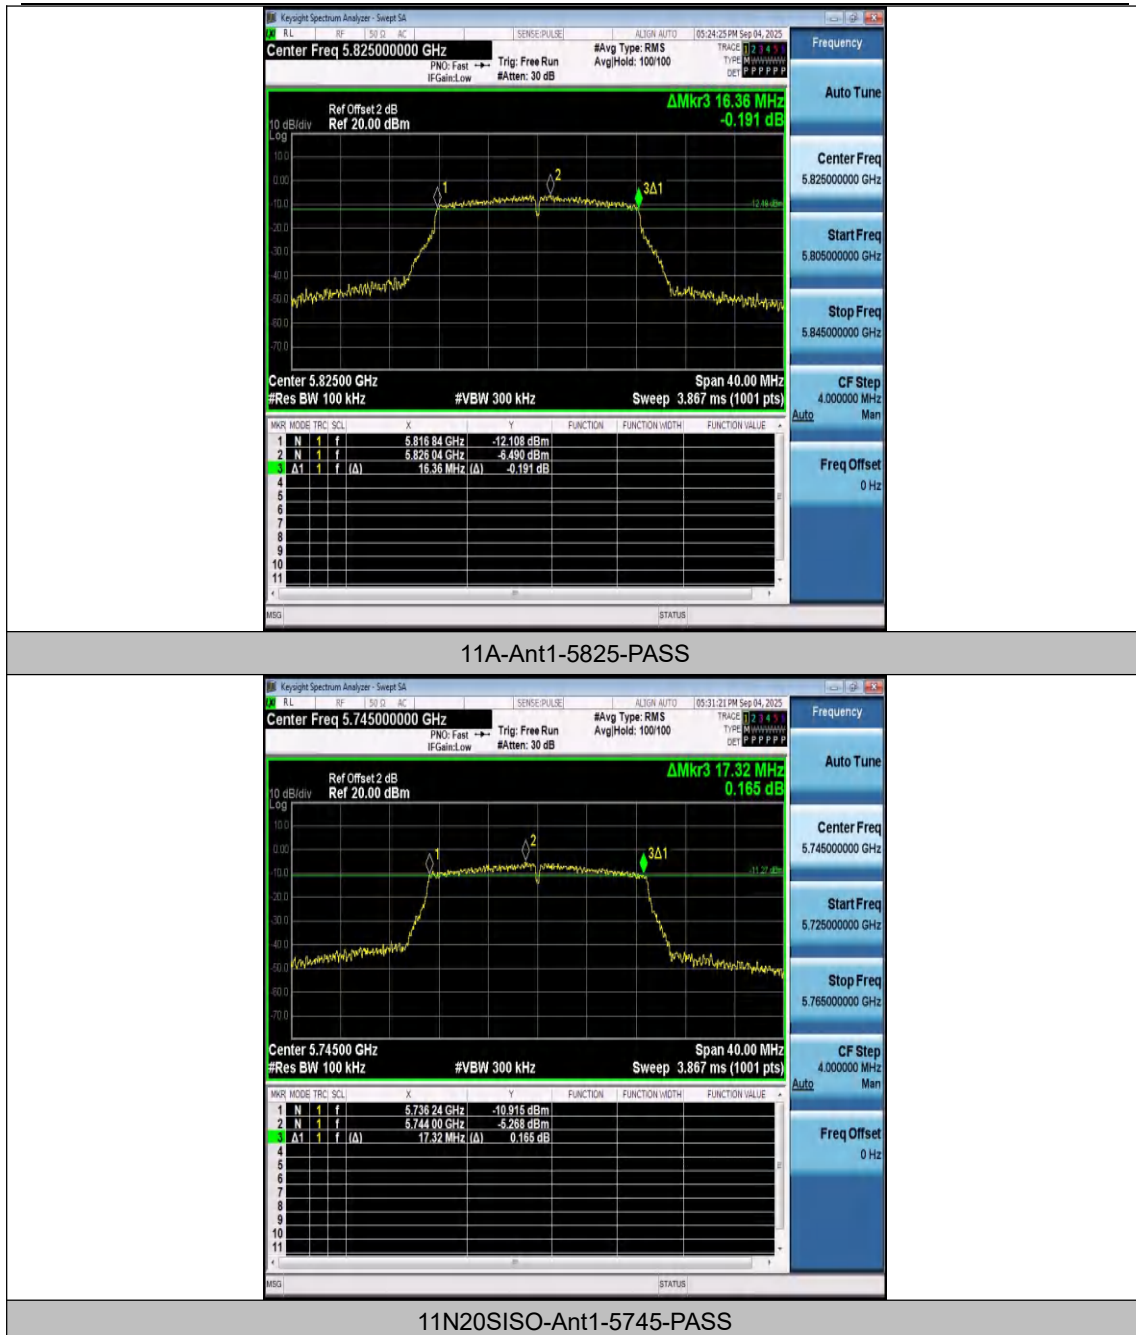

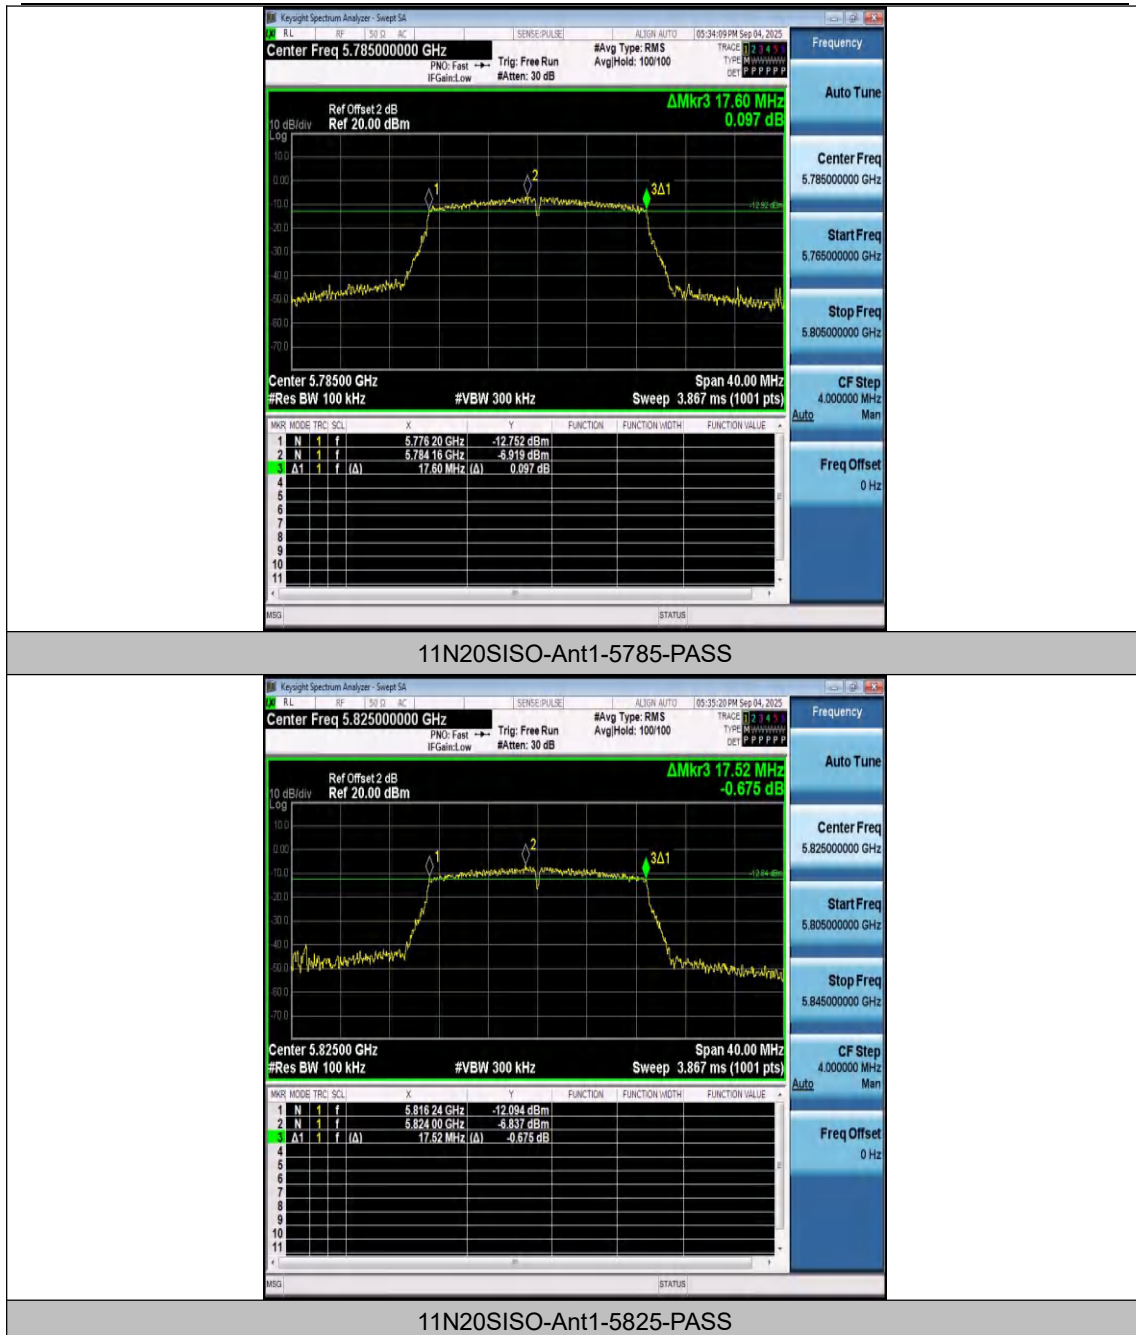

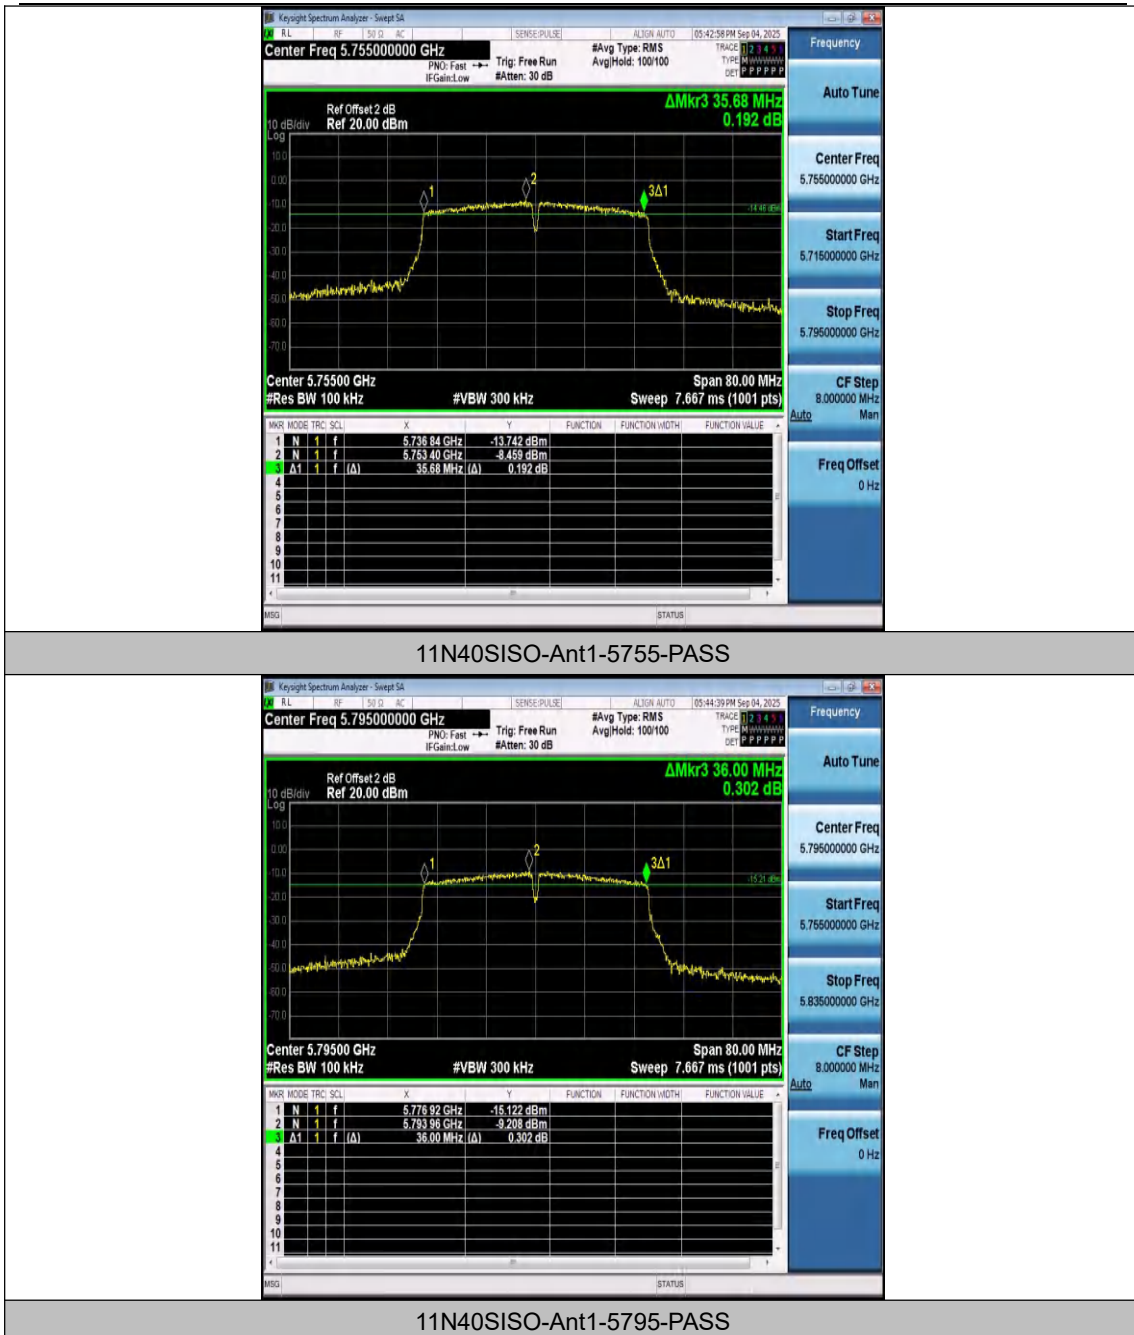


Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency [MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5220	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5220	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01


Test Graphs

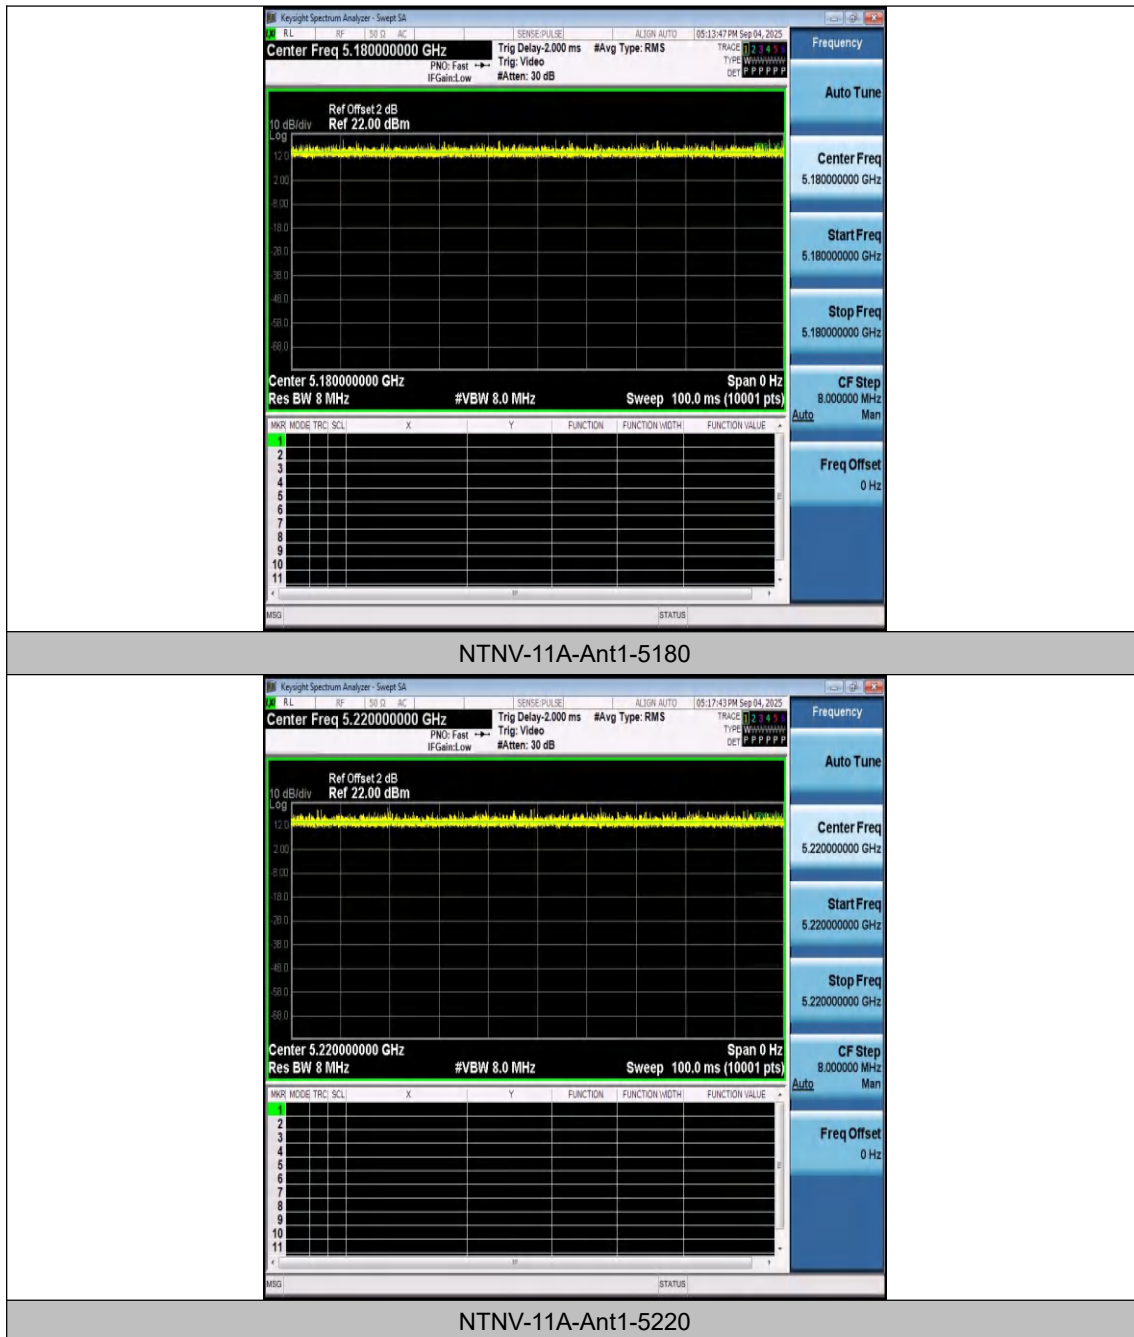

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

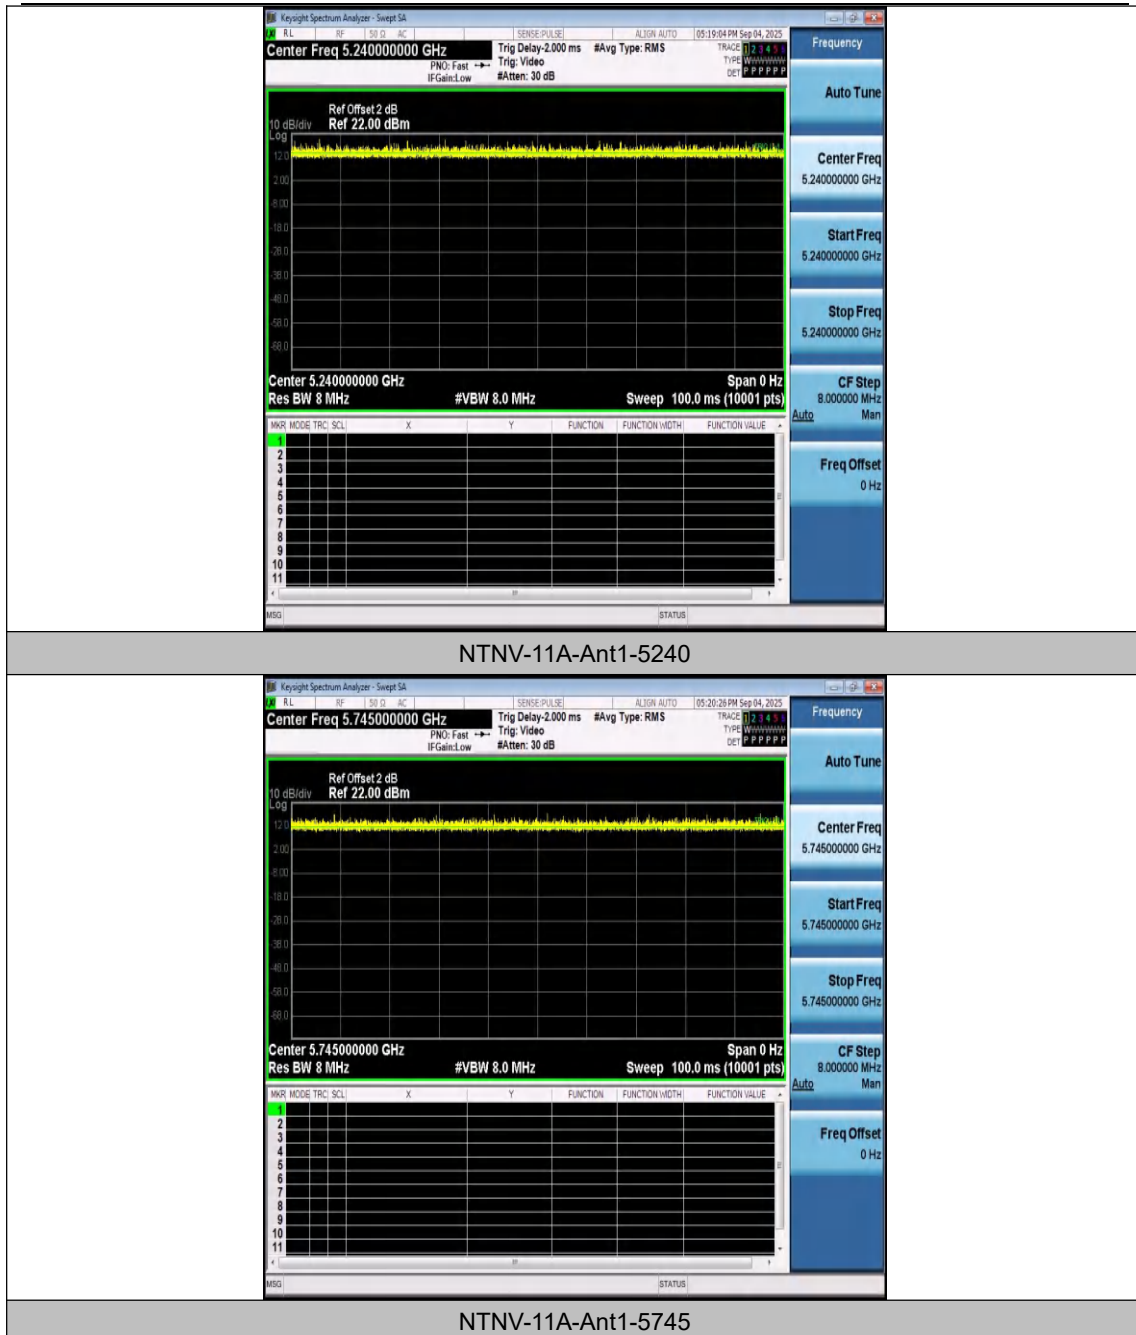

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

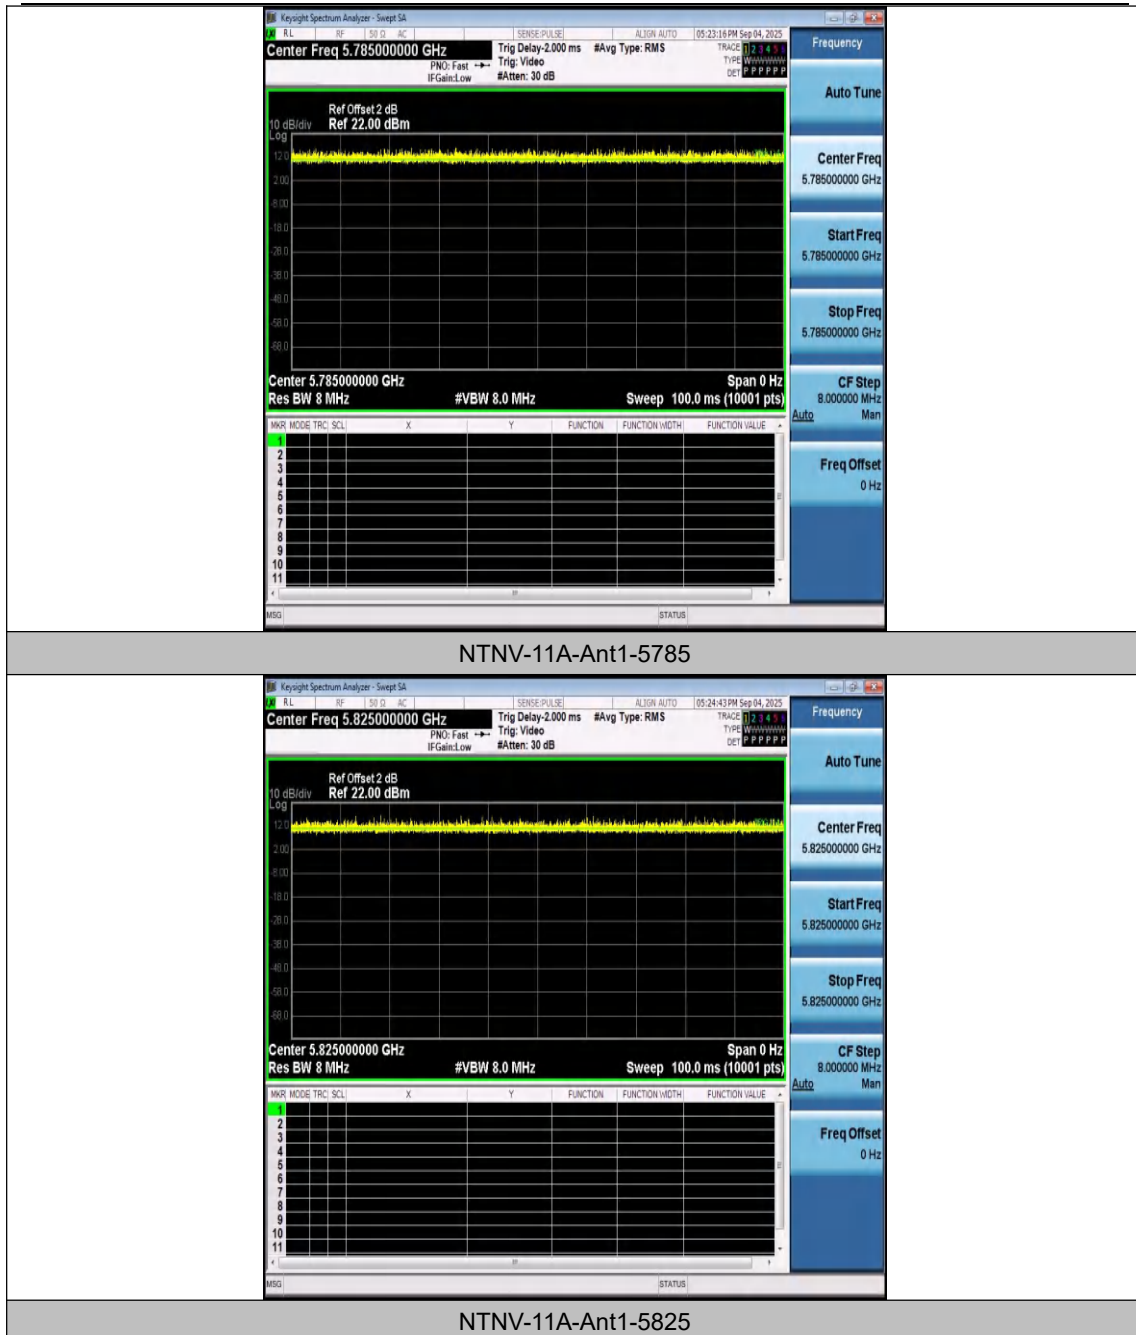

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

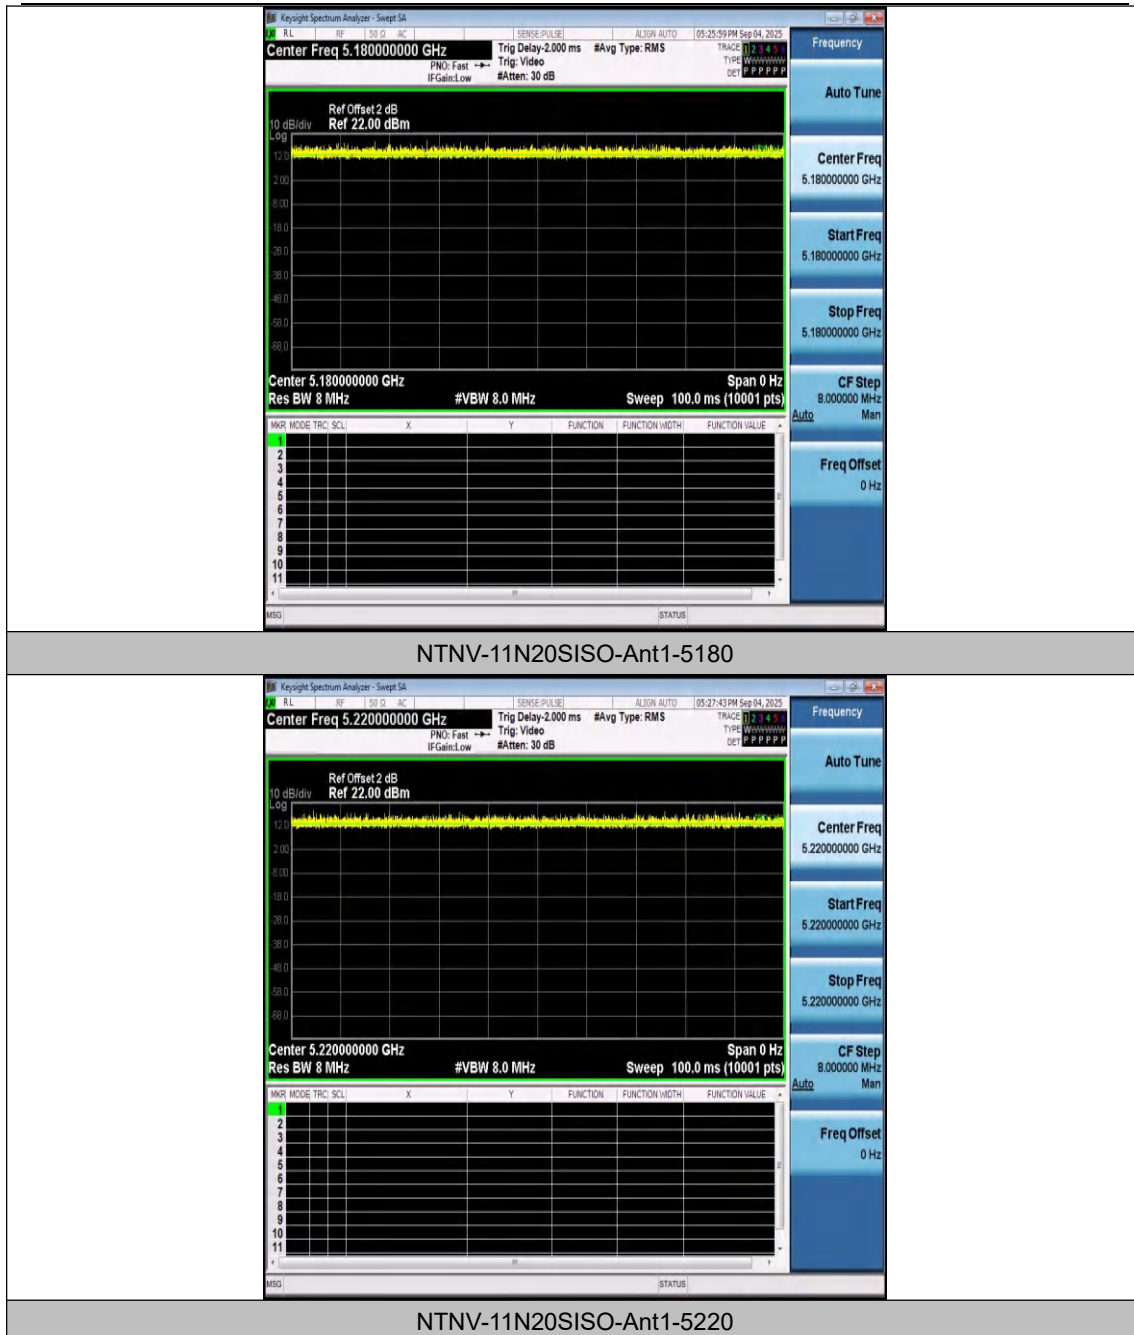

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

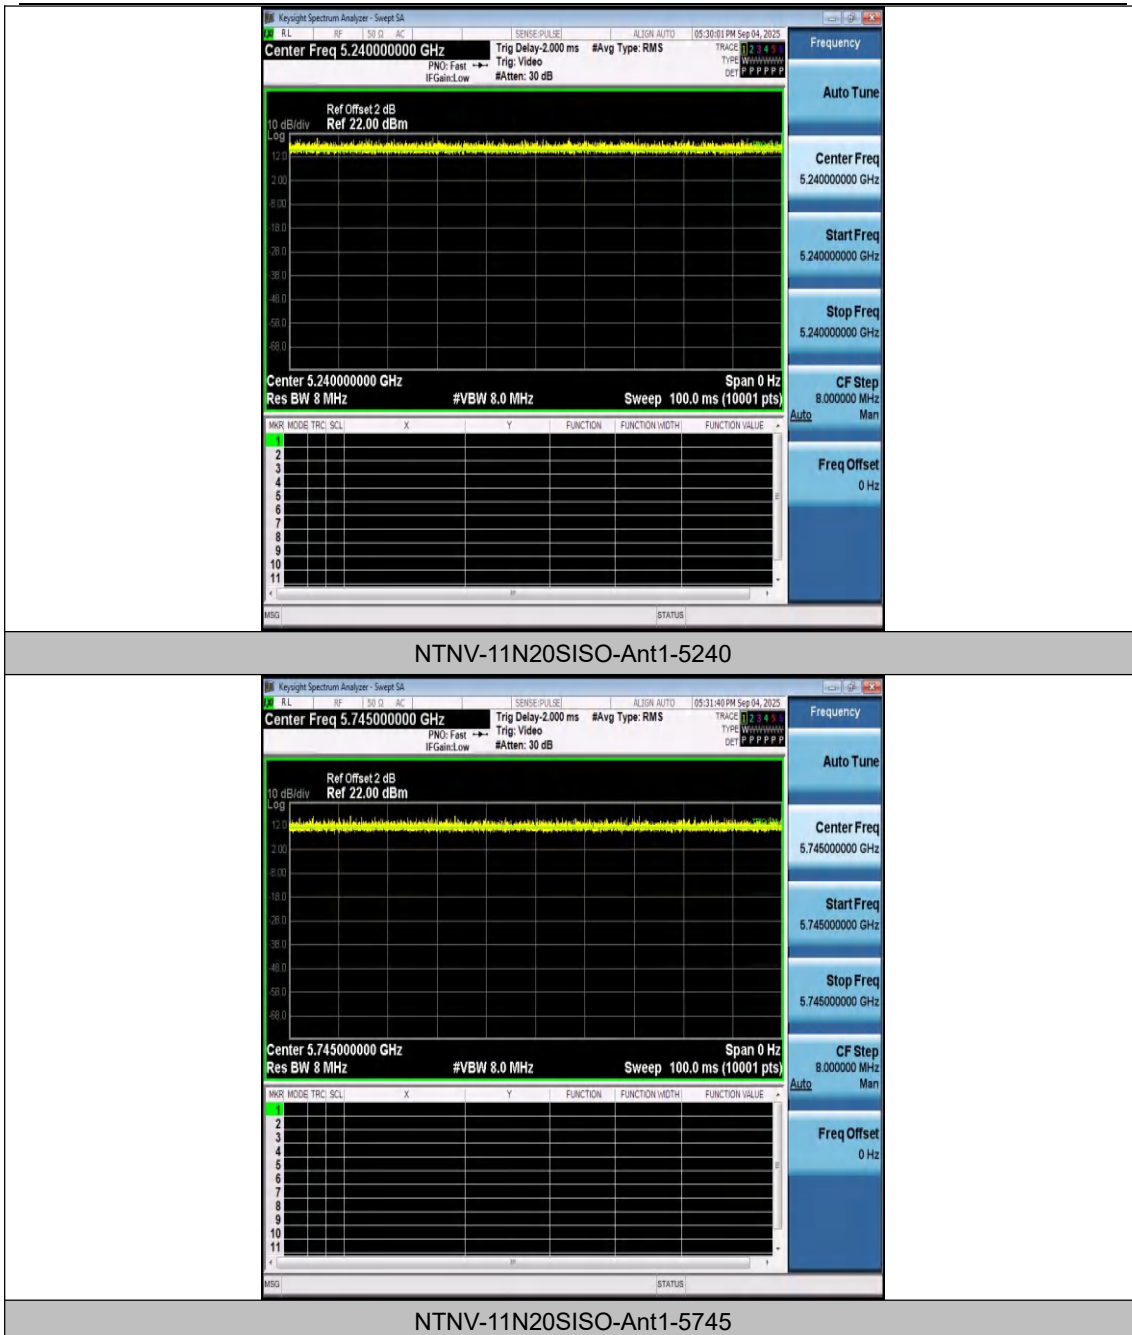

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

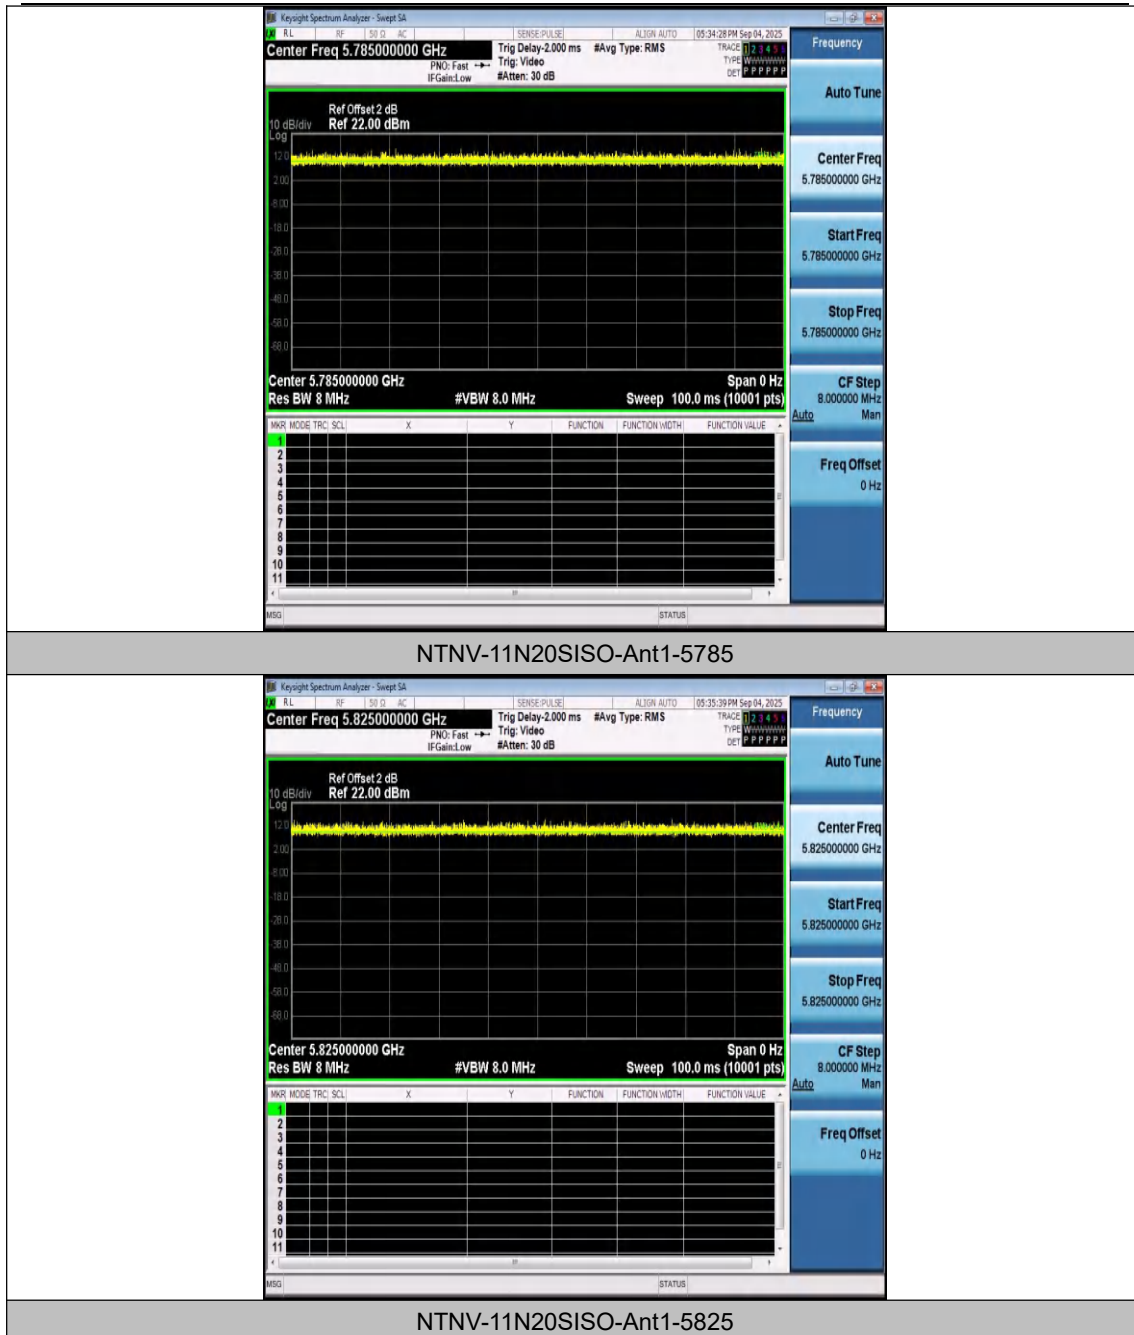

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

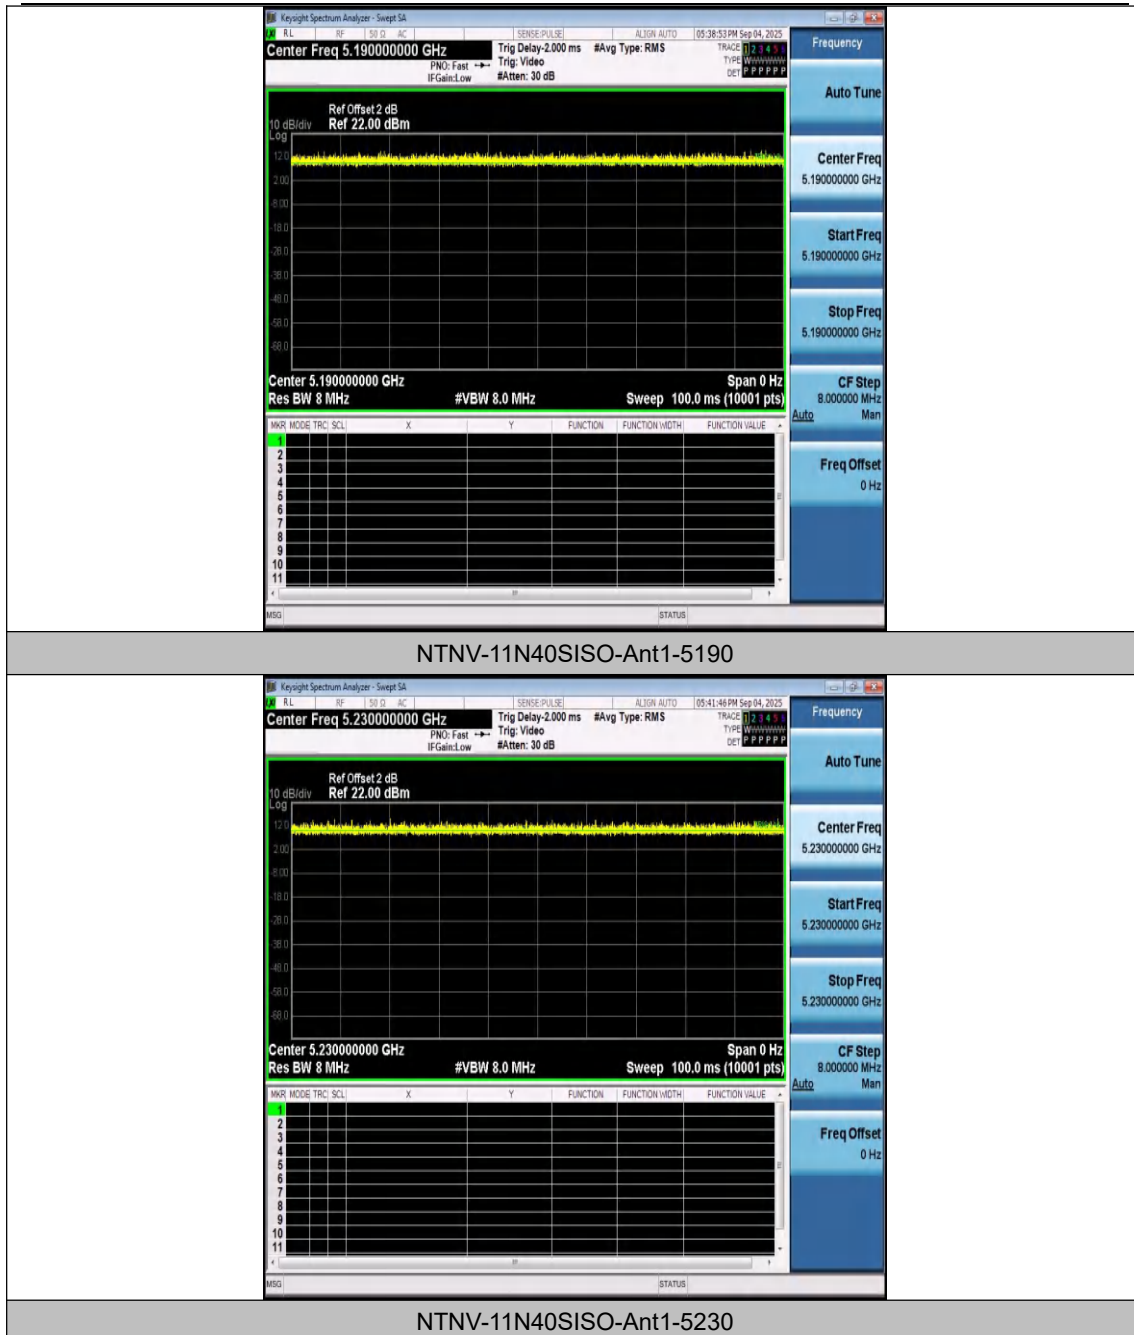

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

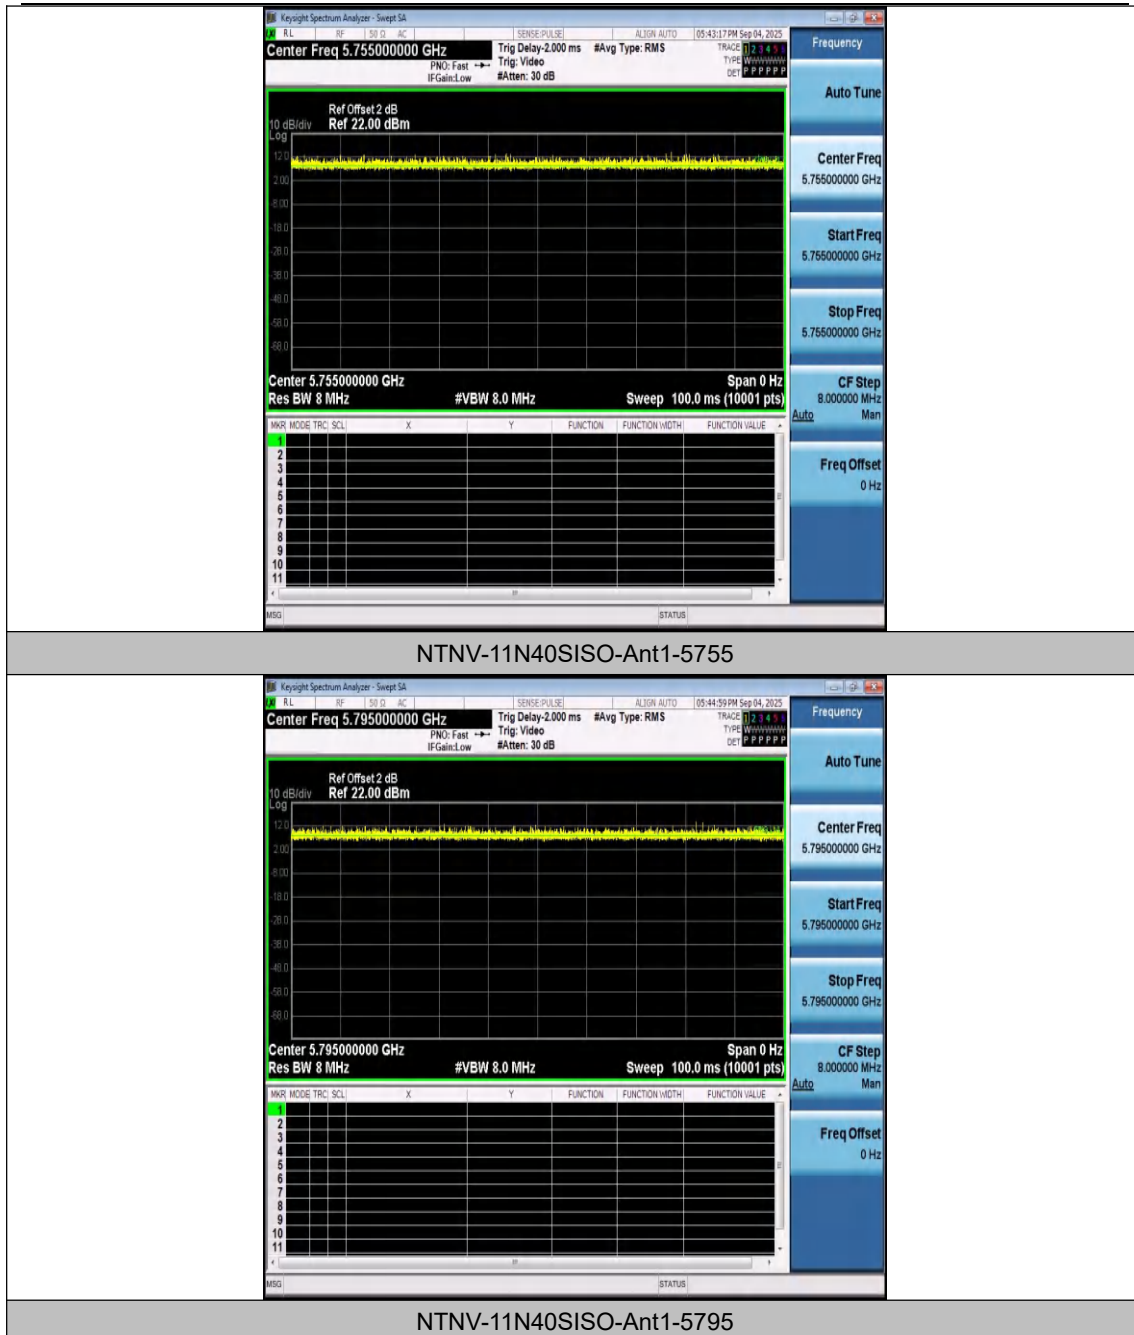

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	13.53	≤23.98	PASS
11A	Ant1	5220	13.36	≤23.98	PASS
11A	Ant1	5240	13.30	≤23.98	PASS
11A	Ant1	5745	11.90	≤30.00	PASS
11A	Ant1	5785	11.56	≤30.00	PASS
11A	Ant1	5825	11.36	≤30.00	PASS
11N20SISO	Ant1	5180	13.58	≤23.98	PASS
11N20SISO	Ant1	5220	13.37	≤23.98	PASS
11N20SISO	Ant1	5240	15.35	≤23.98	PASS
11N20SISO	Ant1	5745	11.97	≤30.00	PASS
11N20SISO	Ant1	5785	10.83	≤30.00	PASS
11N20SISO	Ant1	5825	10.51	≤30.00	PASS
11N40SISO	Ant1	5190	13.00	≤23.98	PASS
11N40SISO	Ant1	5230	13.05	≤23.98	PASS
11N40SISO	Ant1	5755	11.83	≤30.00	PASS
11N40SISO	Ant1	5795	11.23	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.


Test Graphs Channel Power

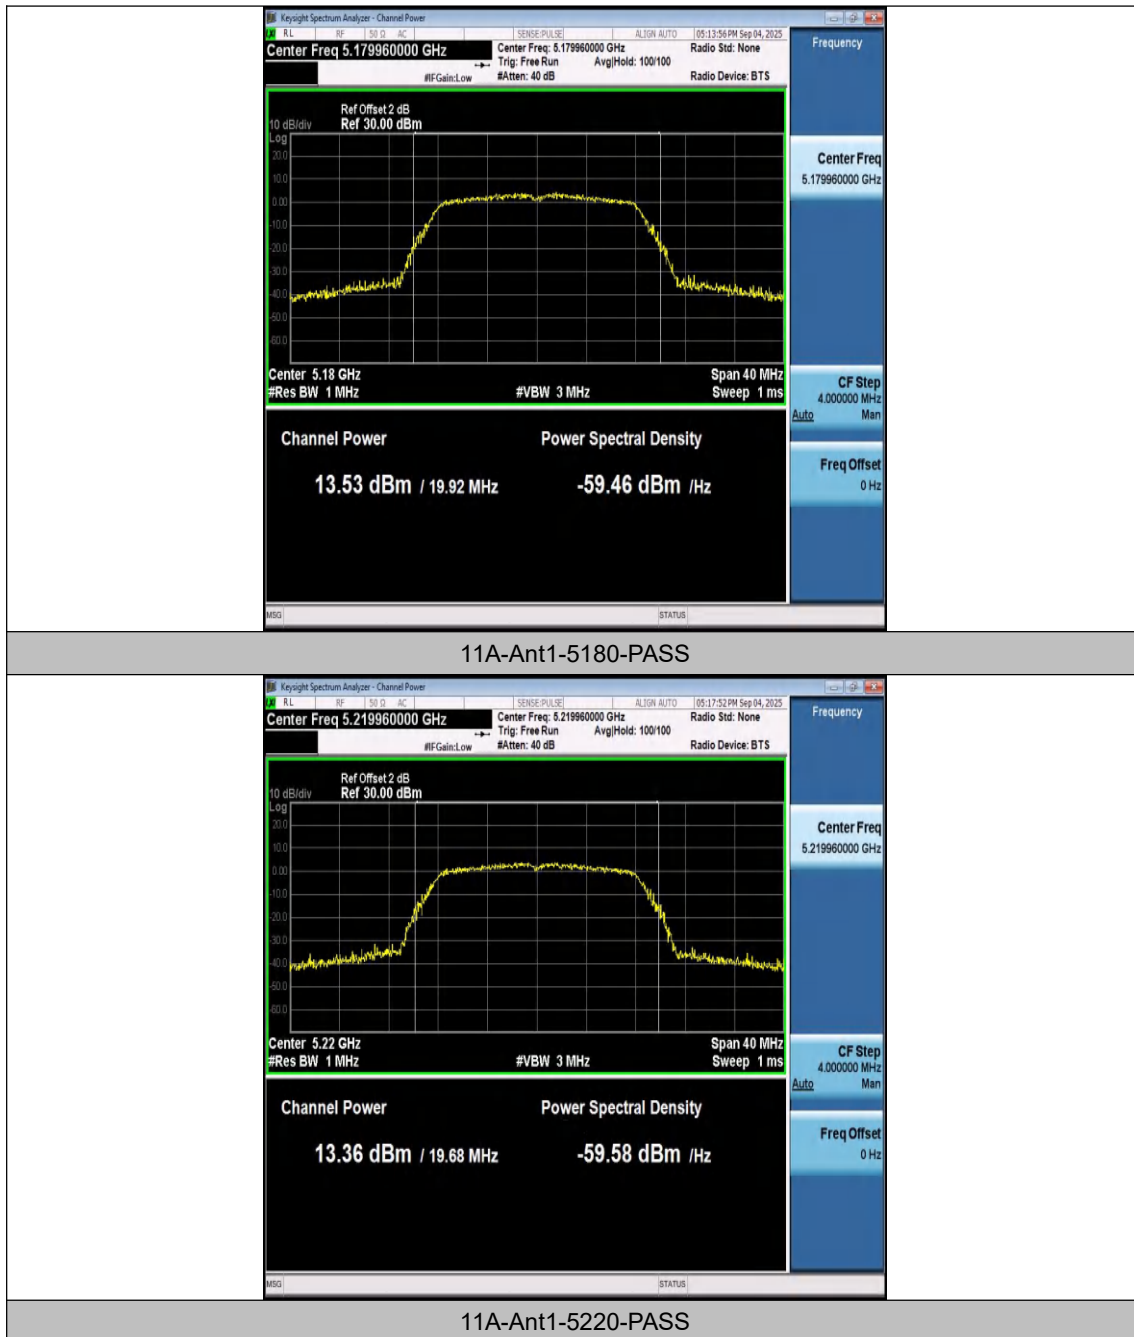

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

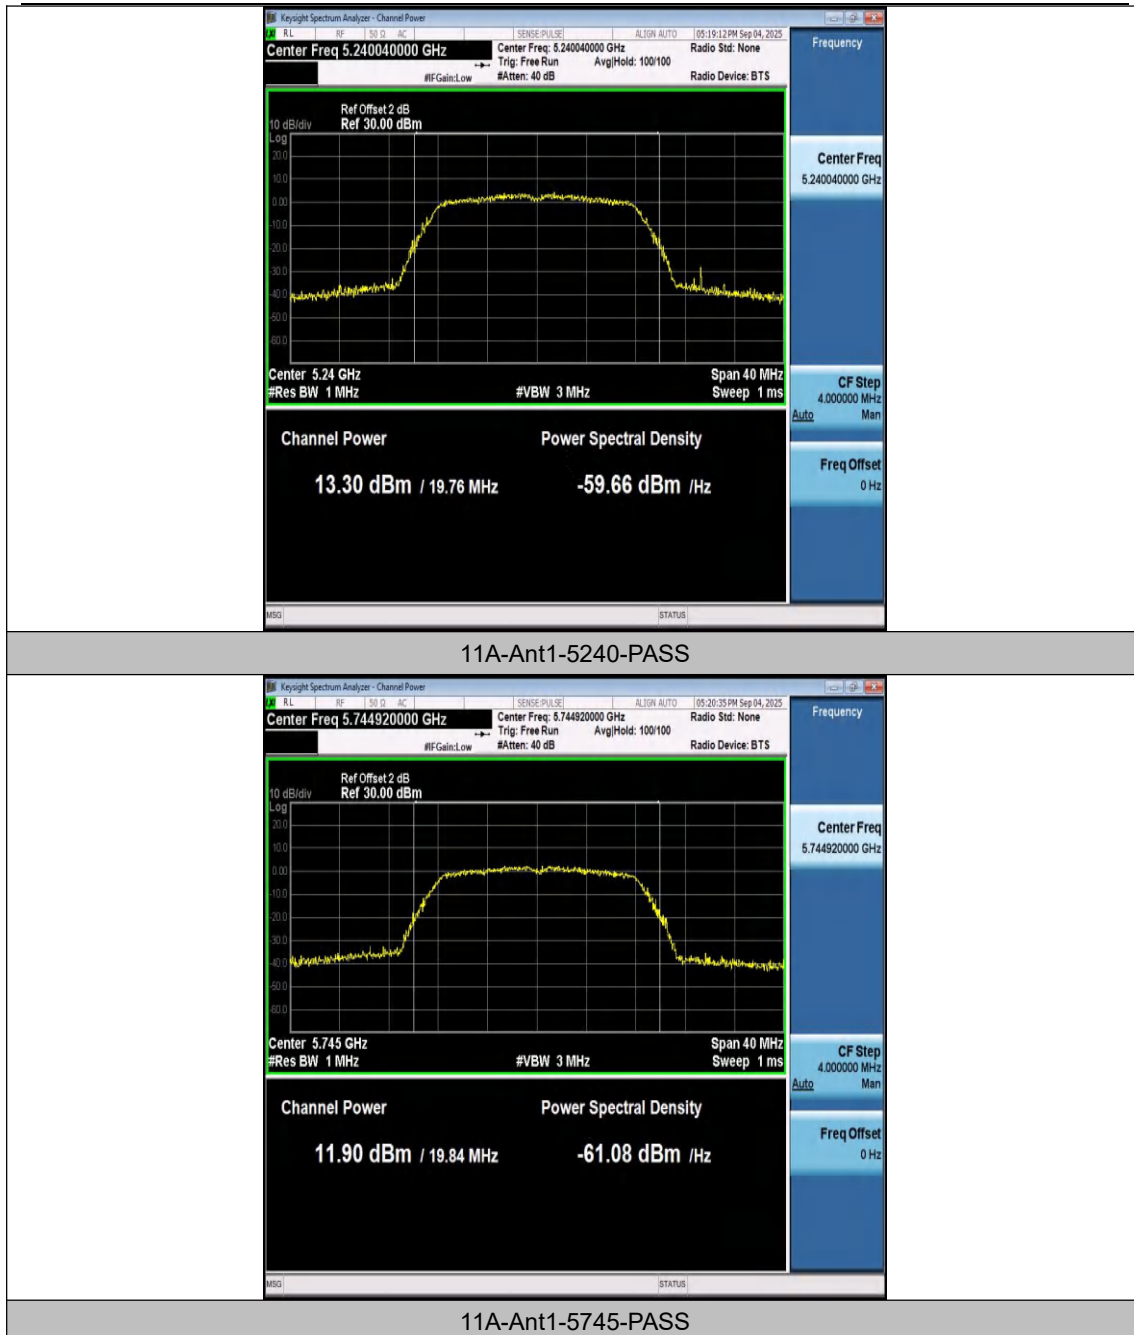

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

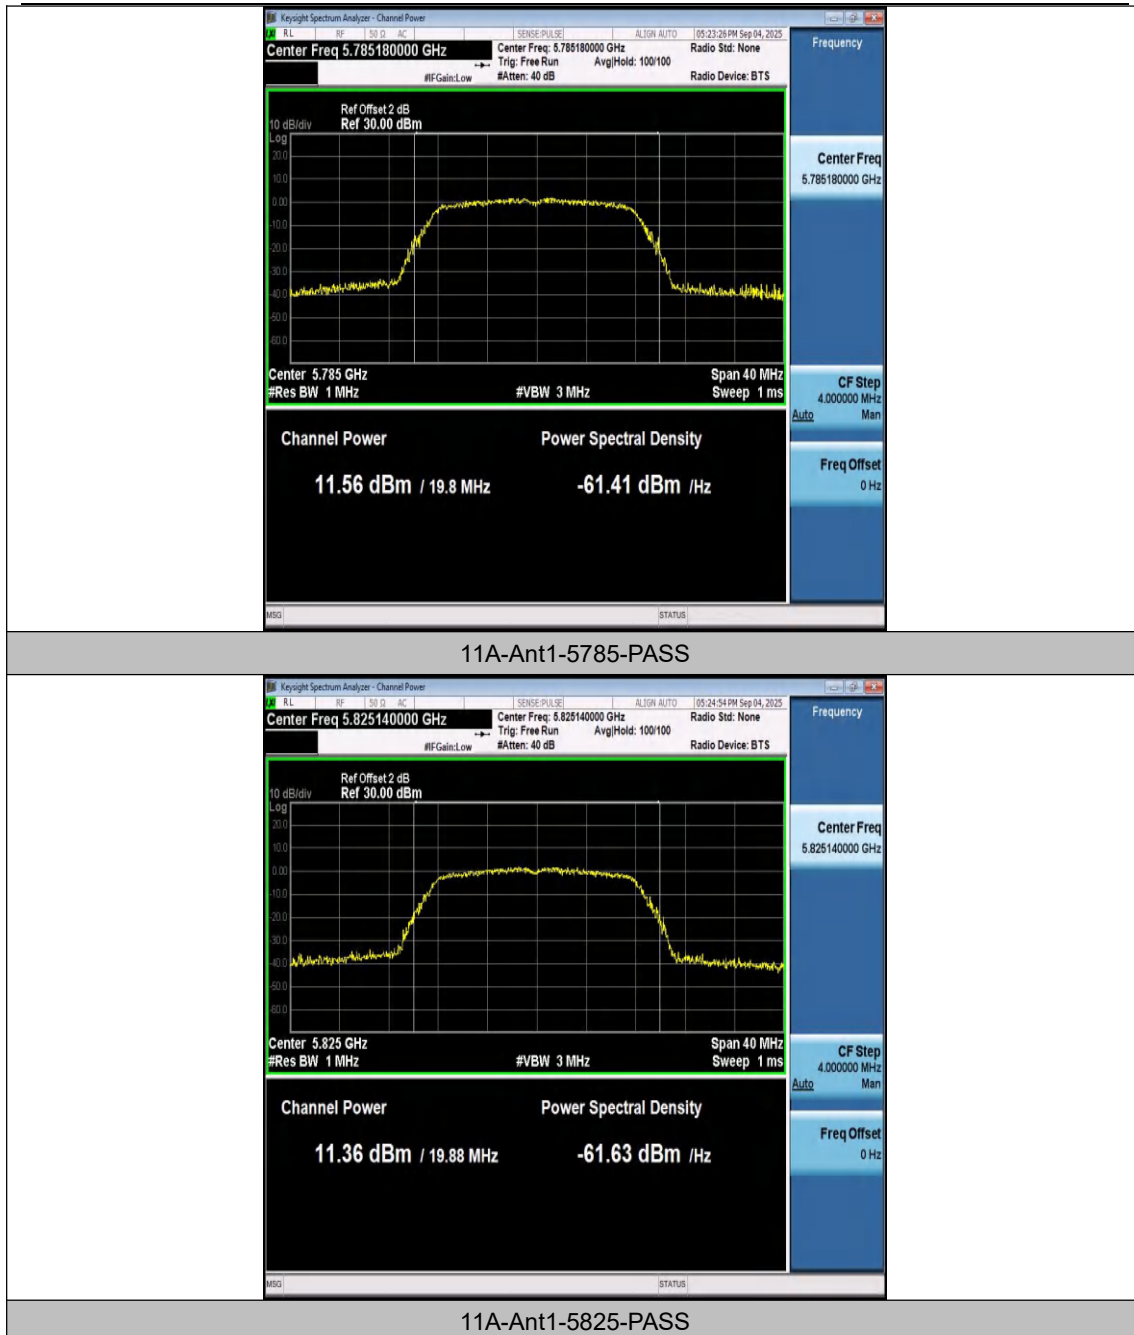


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

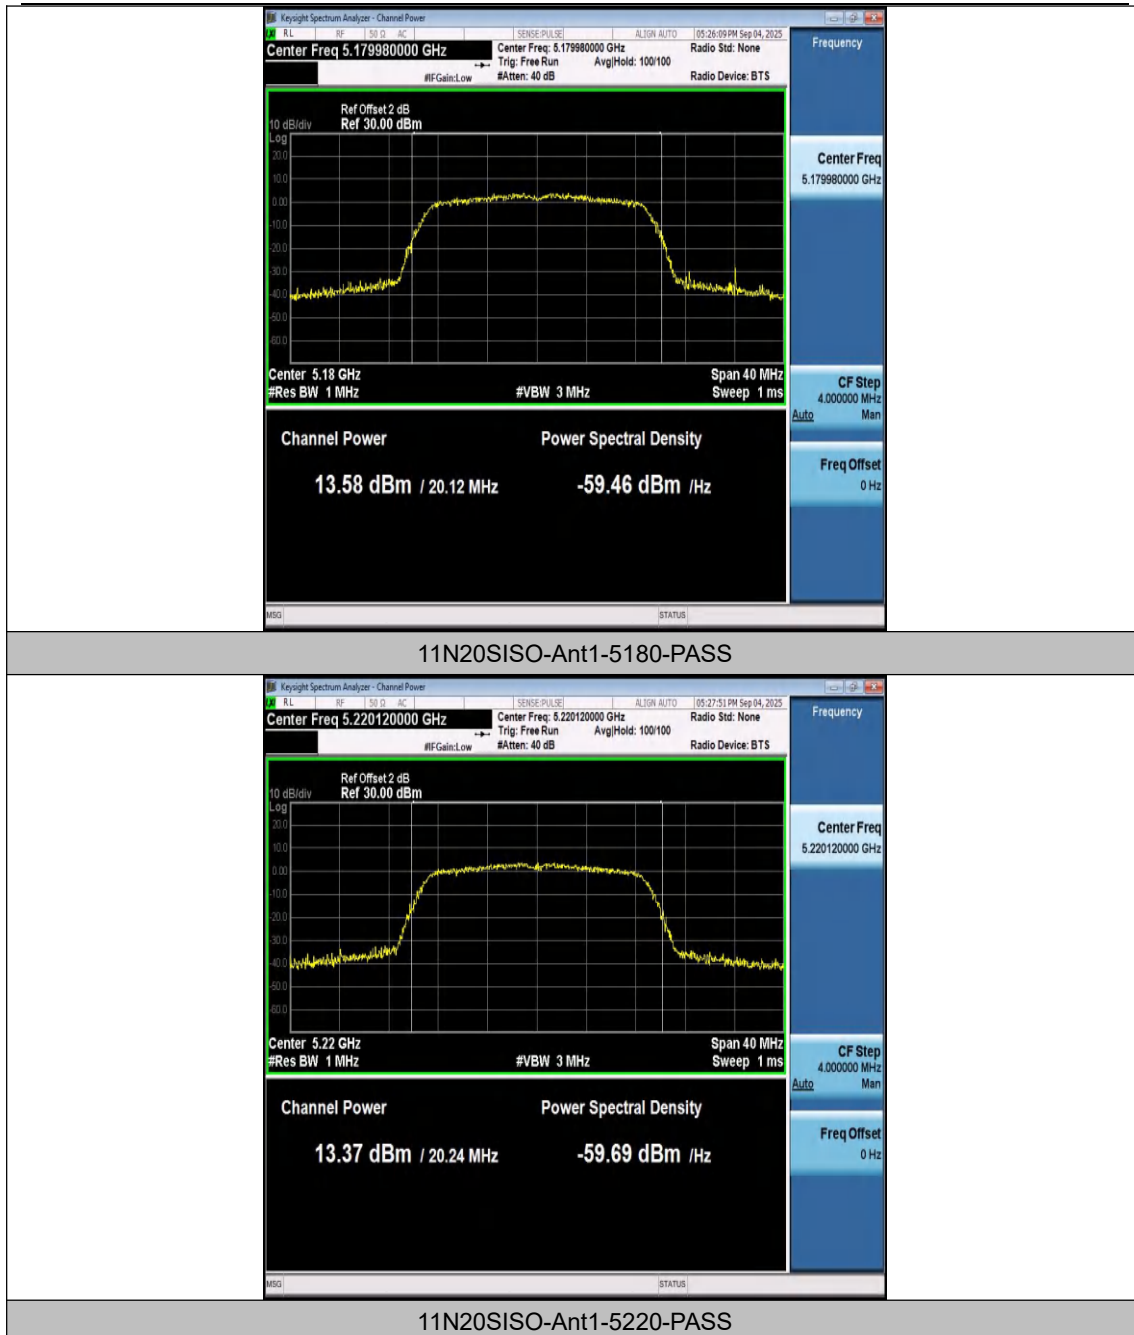


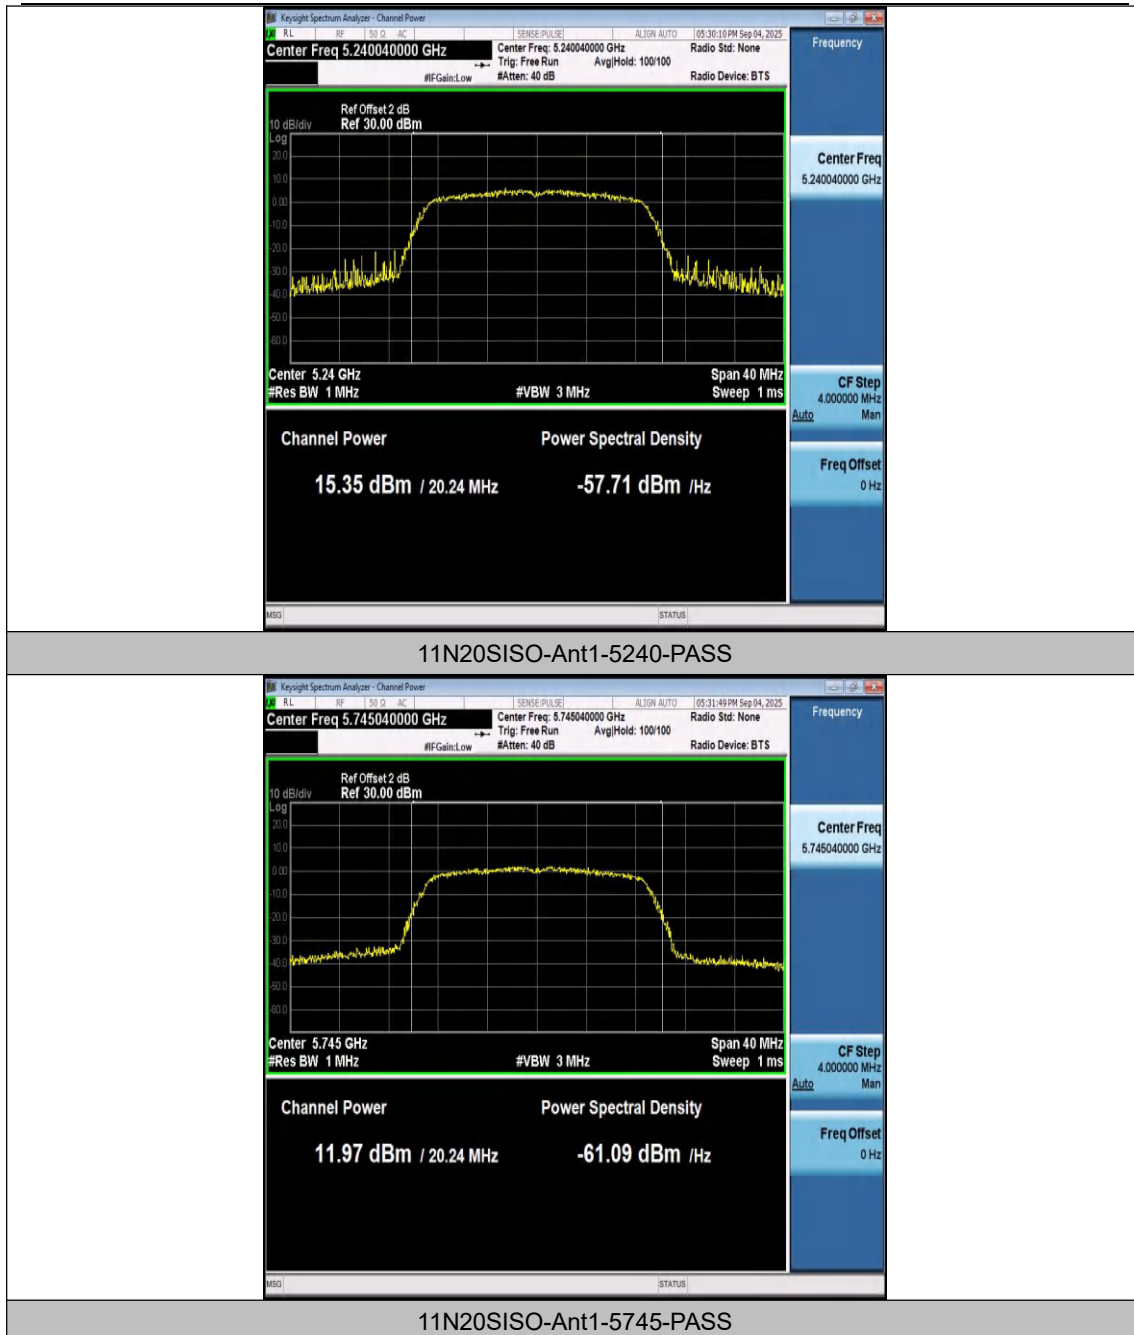

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

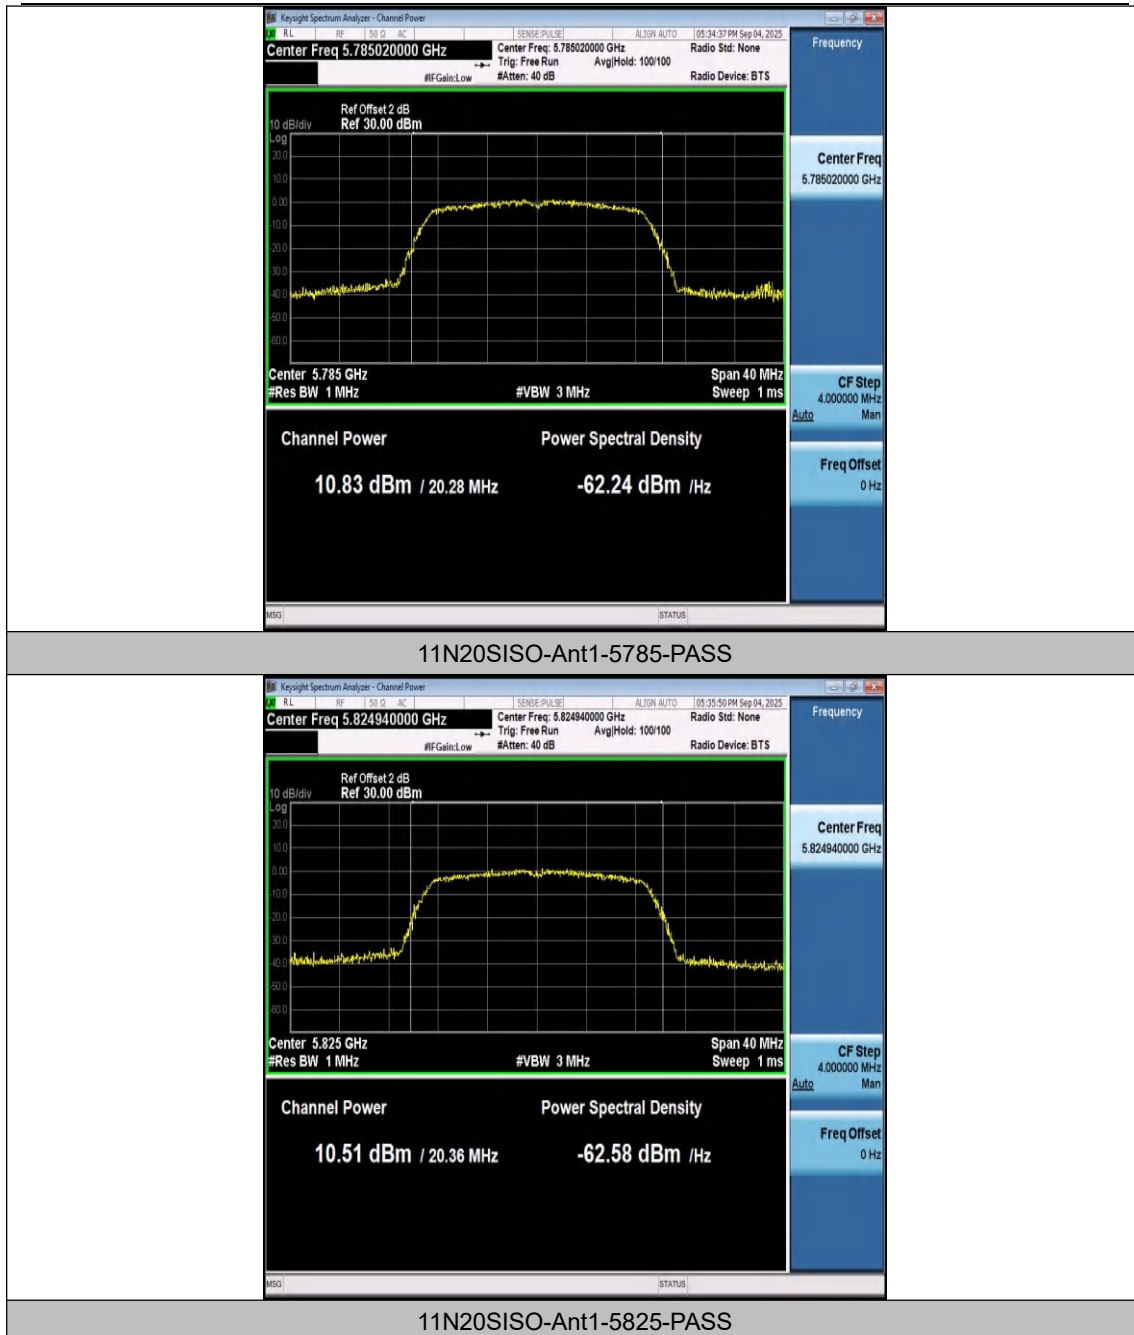


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

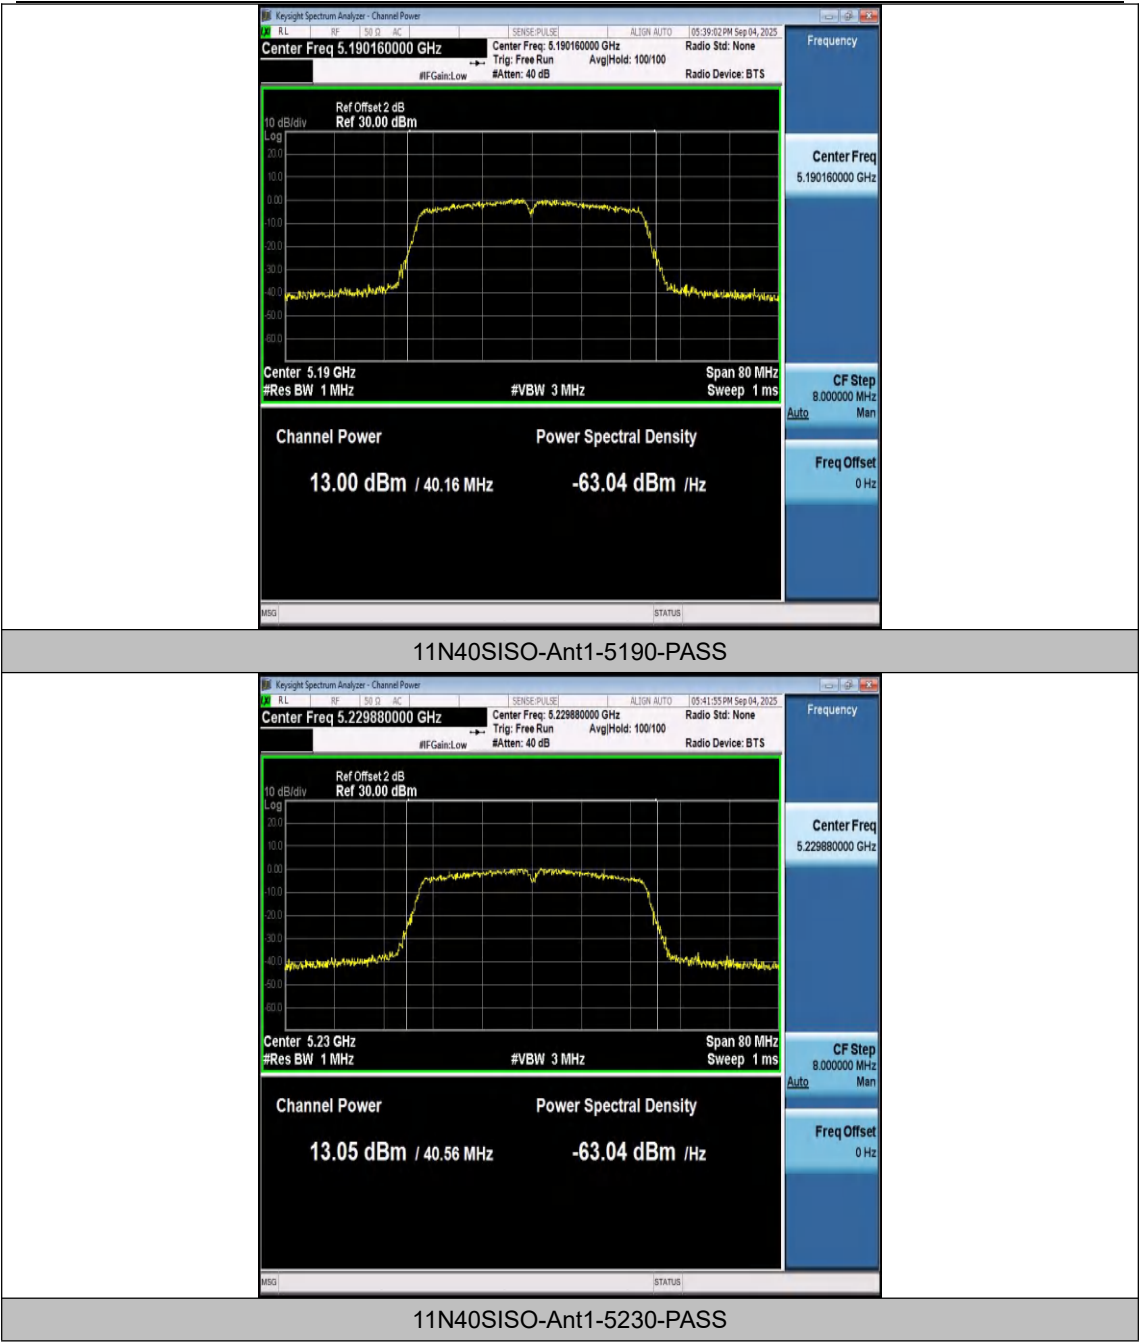

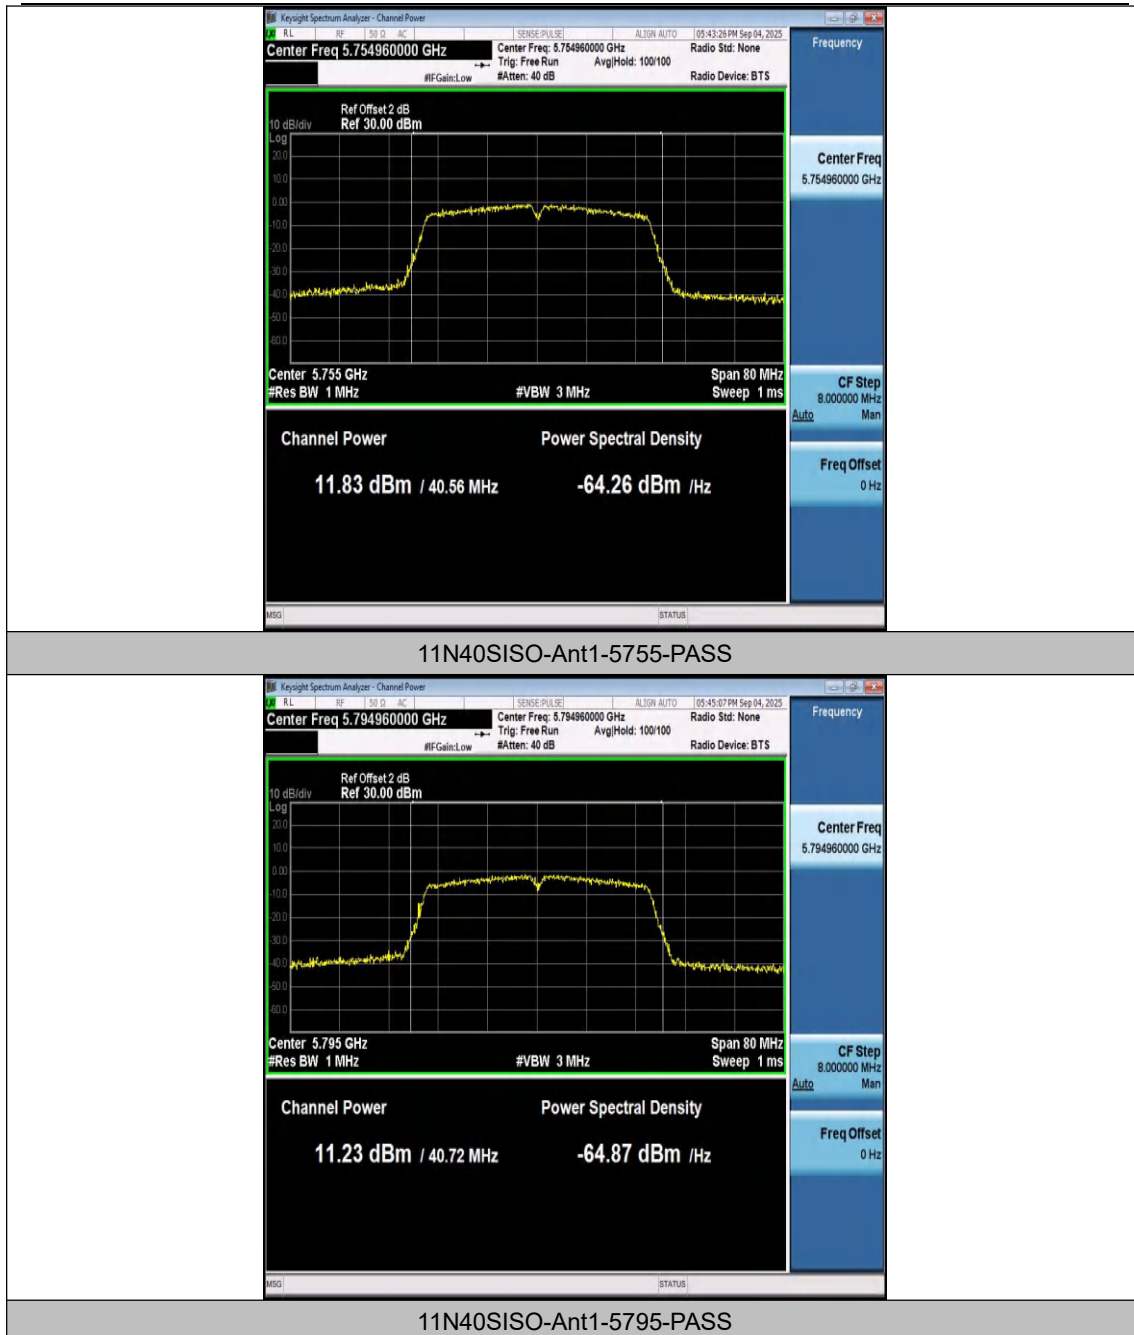

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency [MHz]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-1.10	≤11.00	PASS
11A	Ant1	5220	-1.12	≤11.00	PASS
11A	Ant1	5240	-1.32	≤11.00	PASS
11N20SISO	Ant1	5180	-1.06	≤11.00	PASS
11N20SISO	Ant1	5220	-1.42	≤11.00	PASS
11N20SISO	Ant1	5240	0.63	≤11.00	PASS
11N40SISO	Ant1	5190	-5.31	≤11.00	PASS
11N40SISO	Ant1	5230	-4.75	≤11.00	PASS

Note: 1.The cable loss are compensated in the graph.

Test Result B4


Test Mode	Antenna	Frequency [MHz]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-5.57	≤30.00	PASS
11A	Ant1	5785	-5.92	≤30.00	PASS
11A	Ant1	5825	-6.08	≤30.00	PASS
11N20SISO	Ant1	5745	-5.81	≤30.00	PASS
11N20SISO	Ant1	5785	-6.66	≤30.00	PASS
11N20SISO	Ant1	5825	-6.96	≤30.00	PASS
11N40SISO	Ant1	5755	-8.68	≤30.00	PASS
11N40SISO	Ant1	5795	-9.44	≤30.00	PASS

Note:

1.The cable loss and RBW Factor are compensated in the graph.

2.Offset=cable loss(2dB) + RBW Factor (-0.09dB)


Test Graphs B1

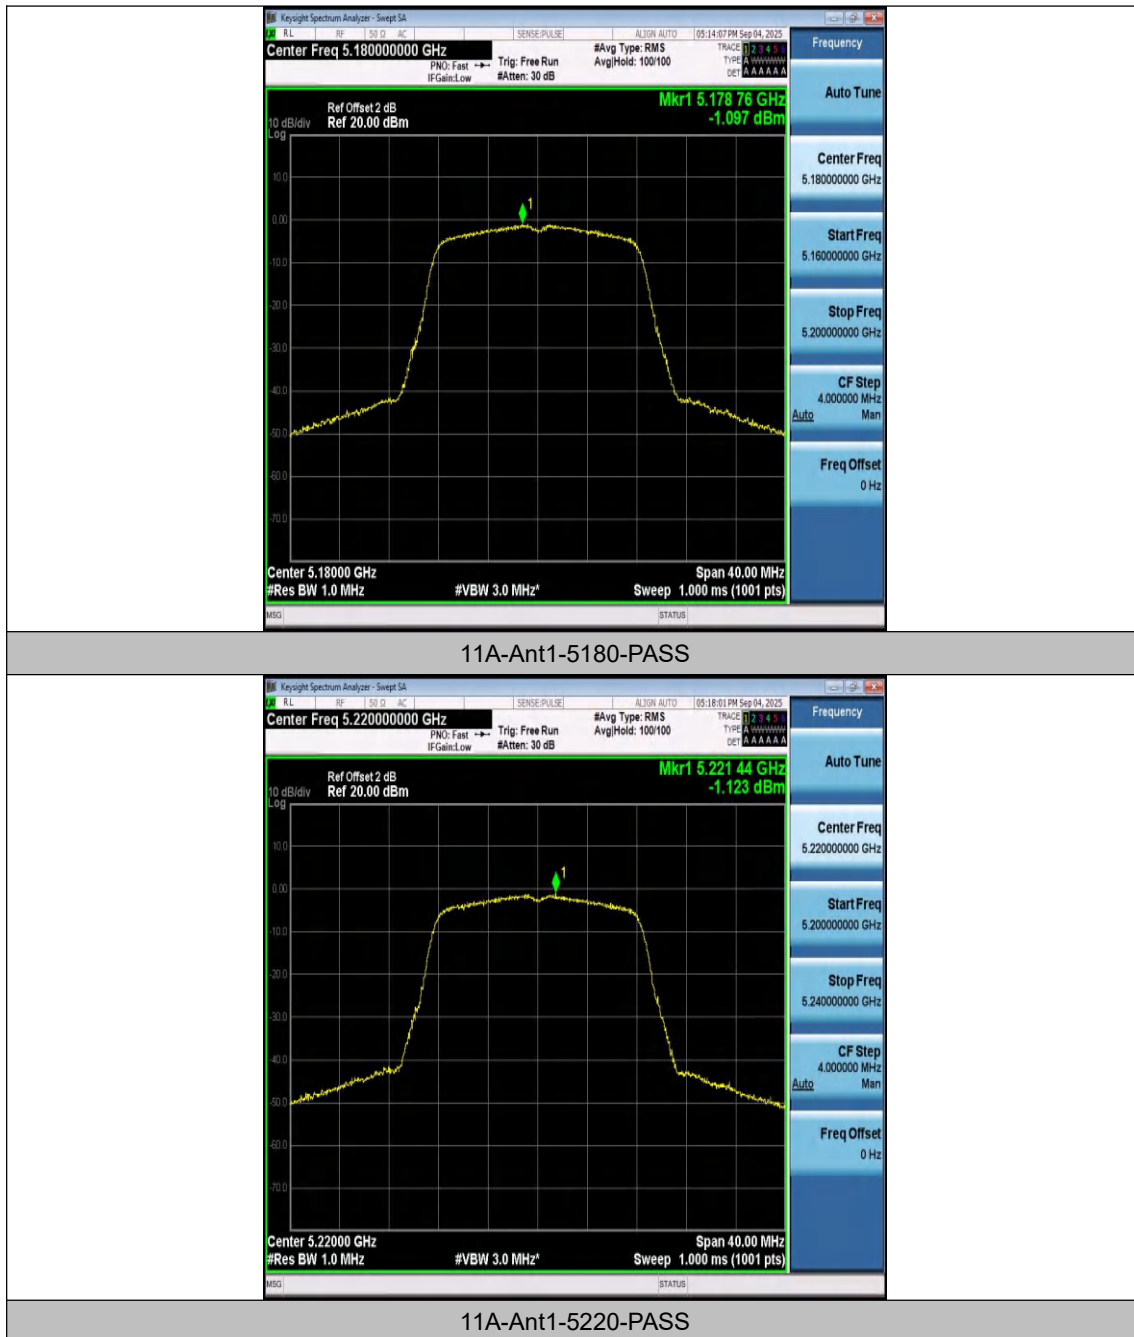

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

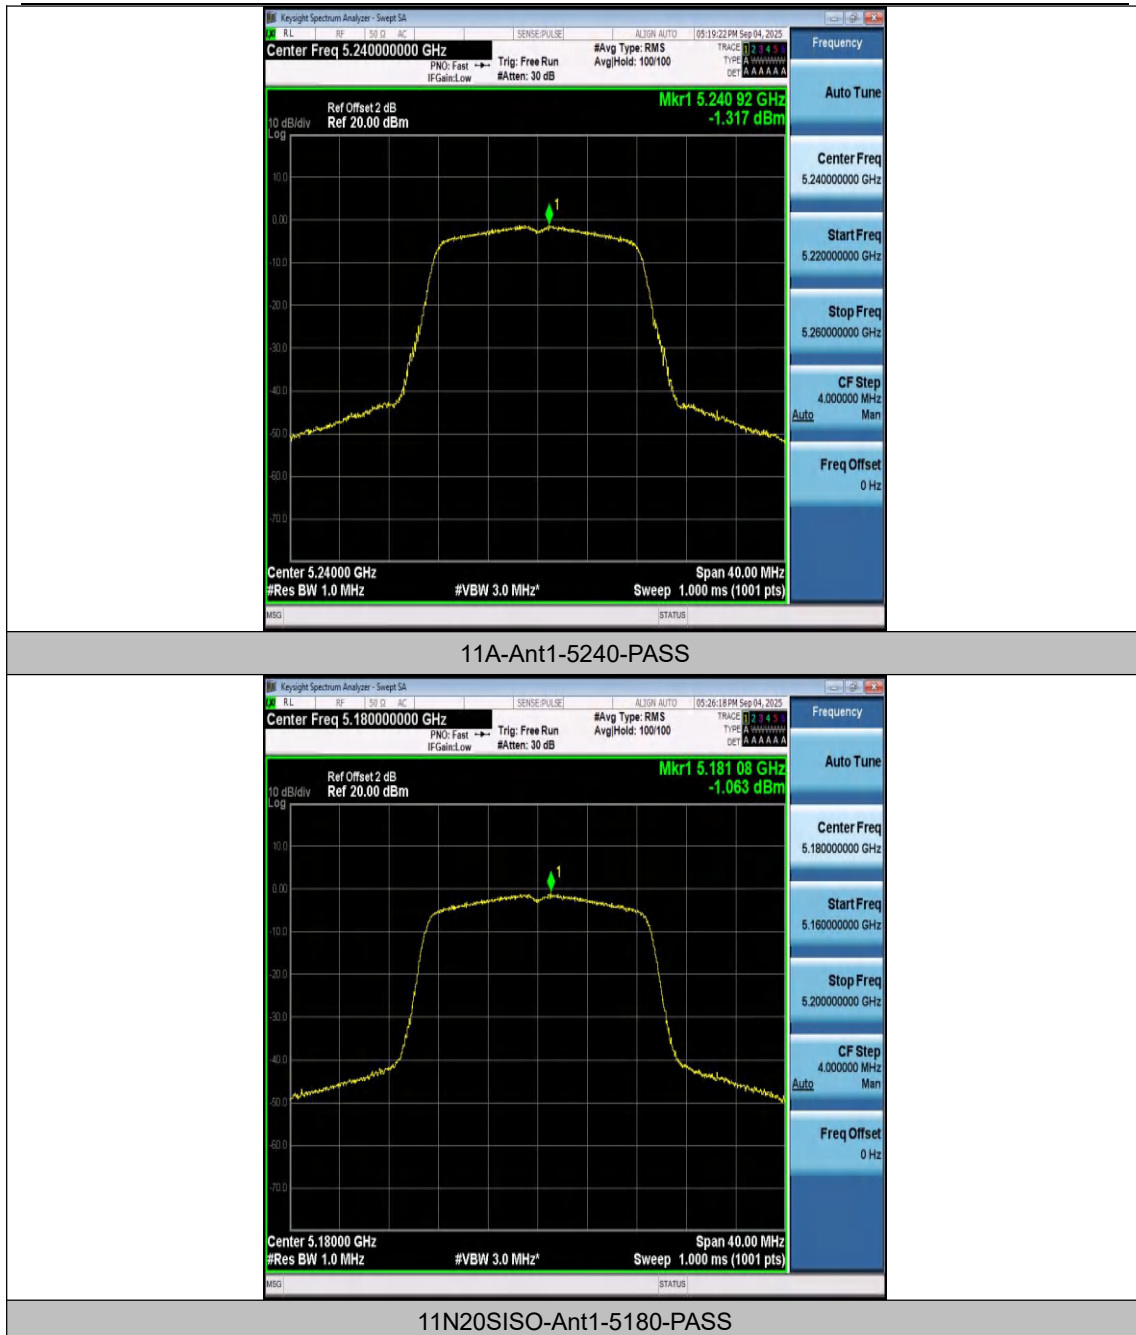

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

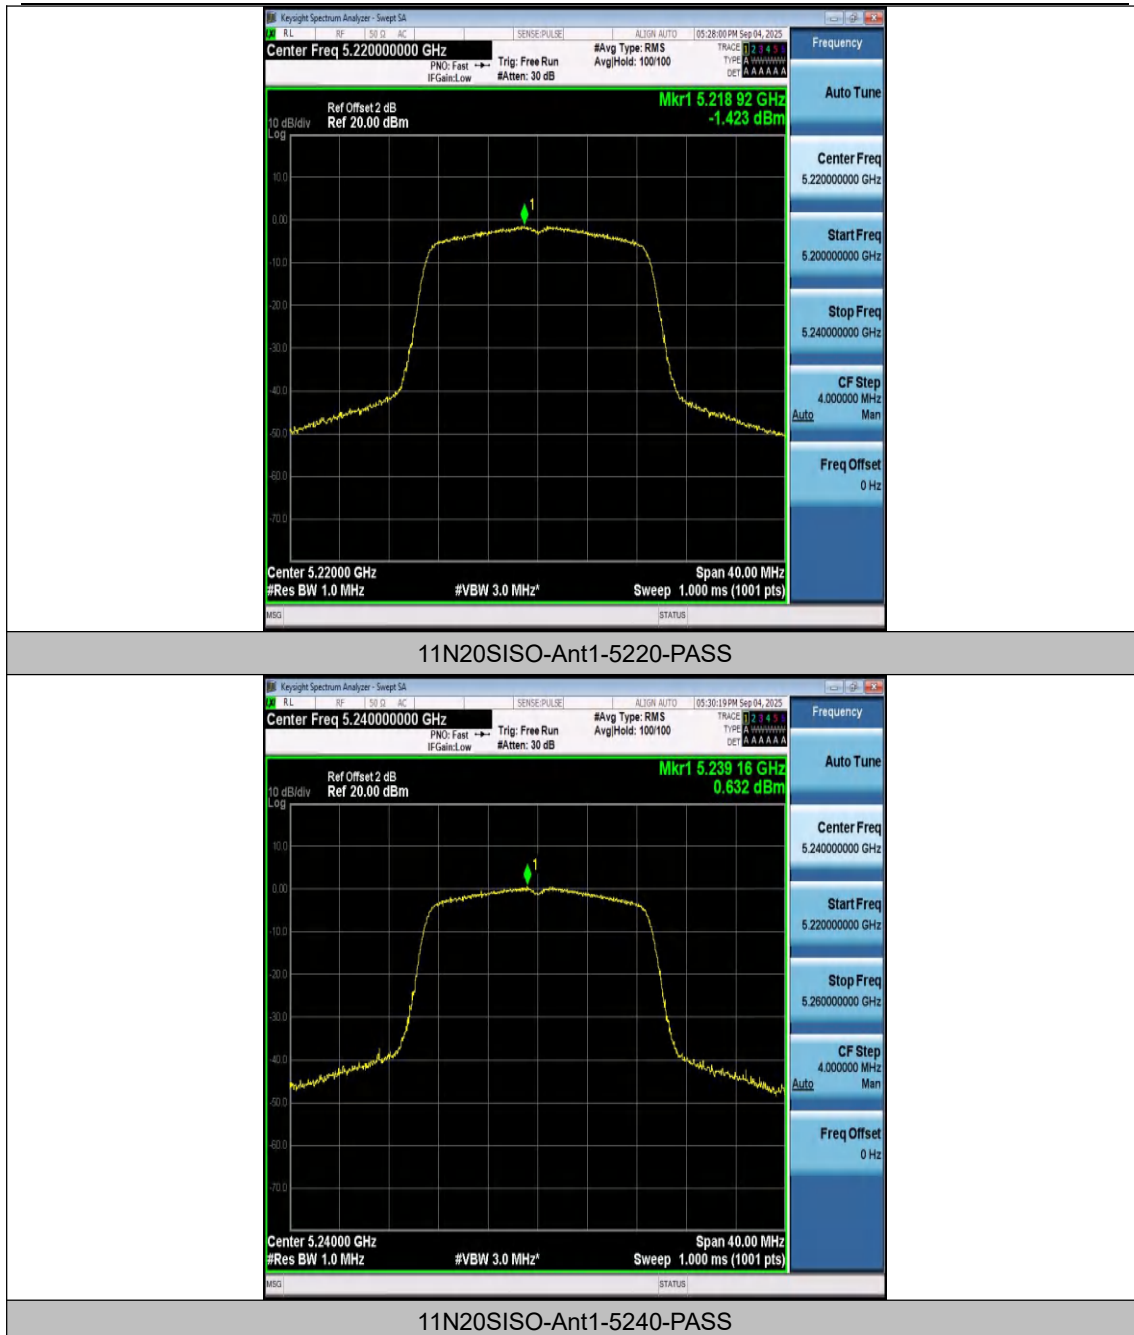

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

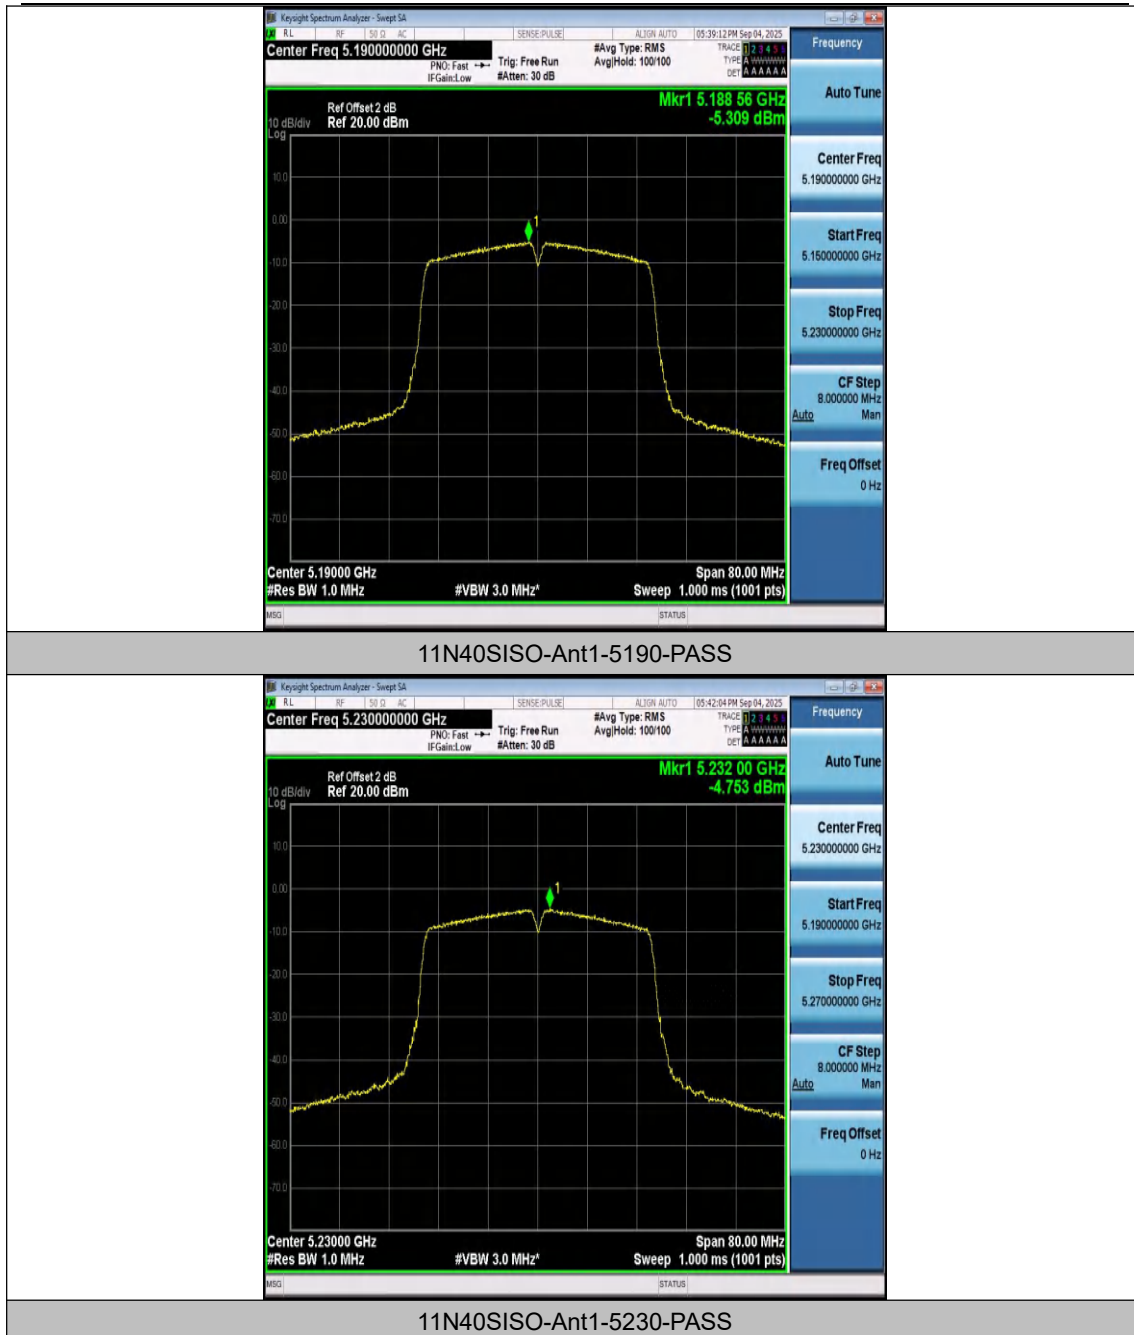


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test GraphsB4

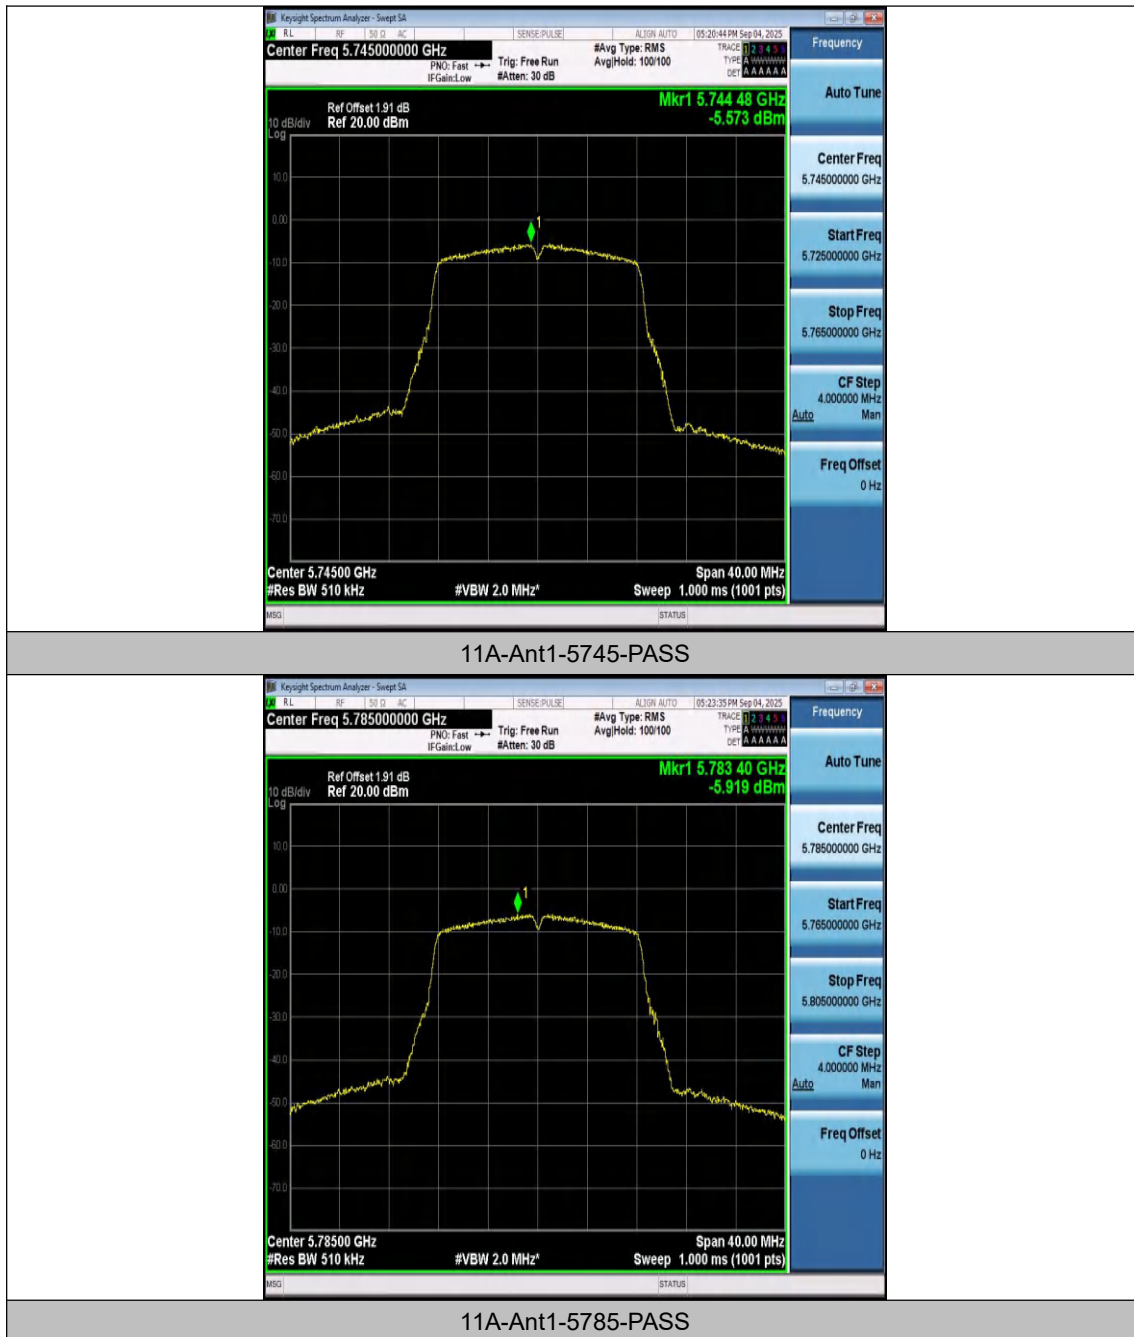

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

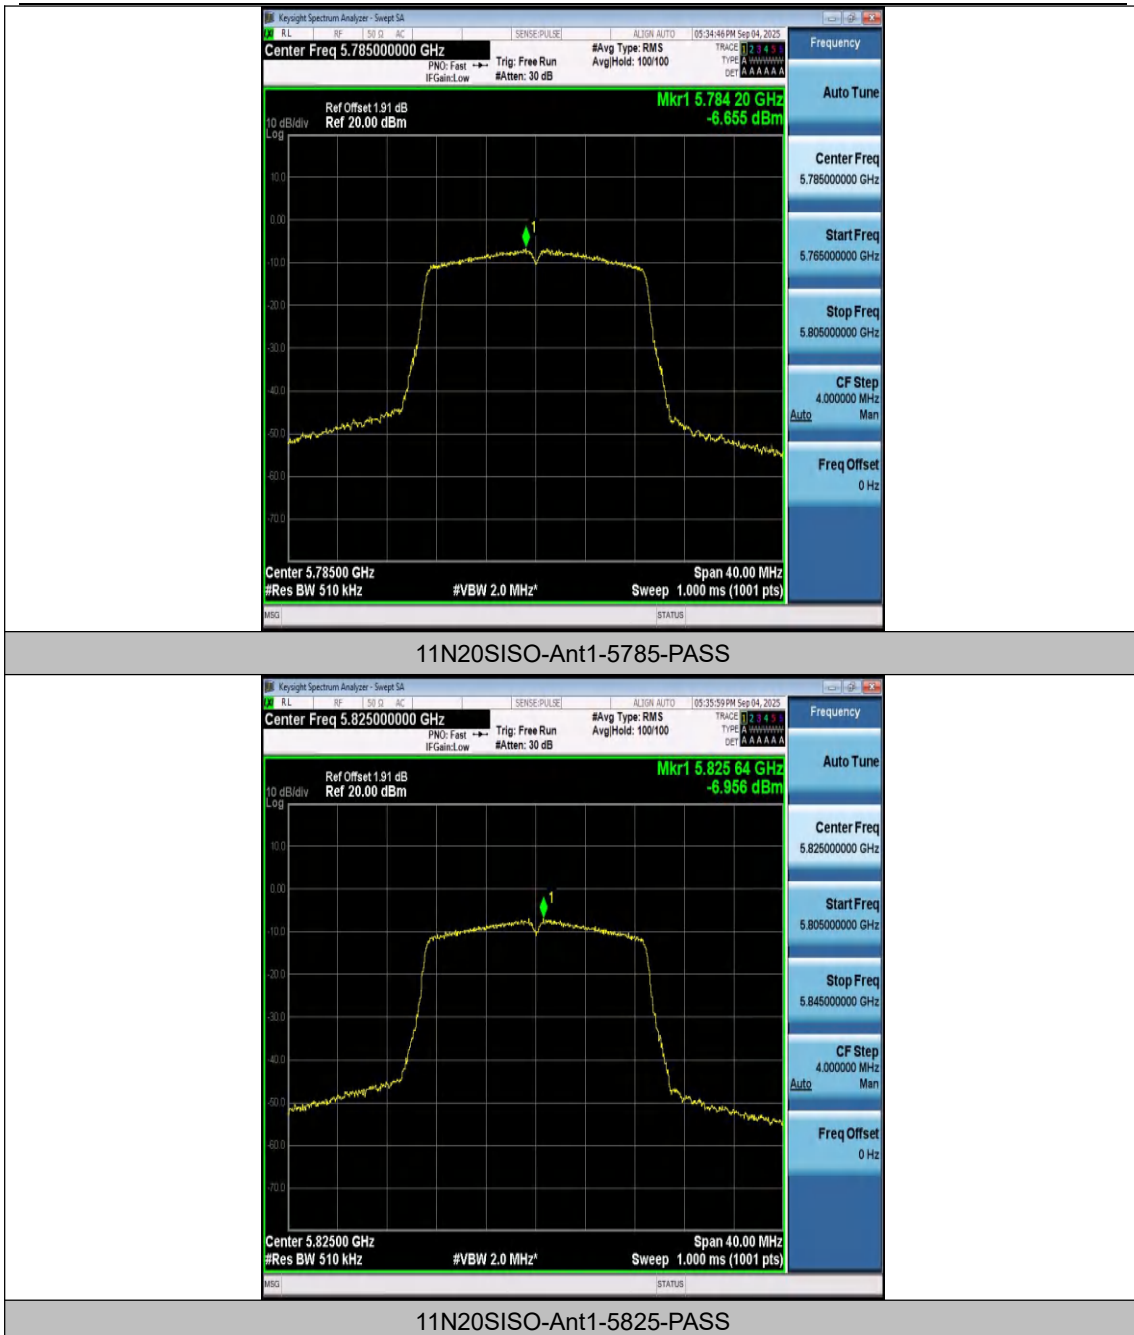

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

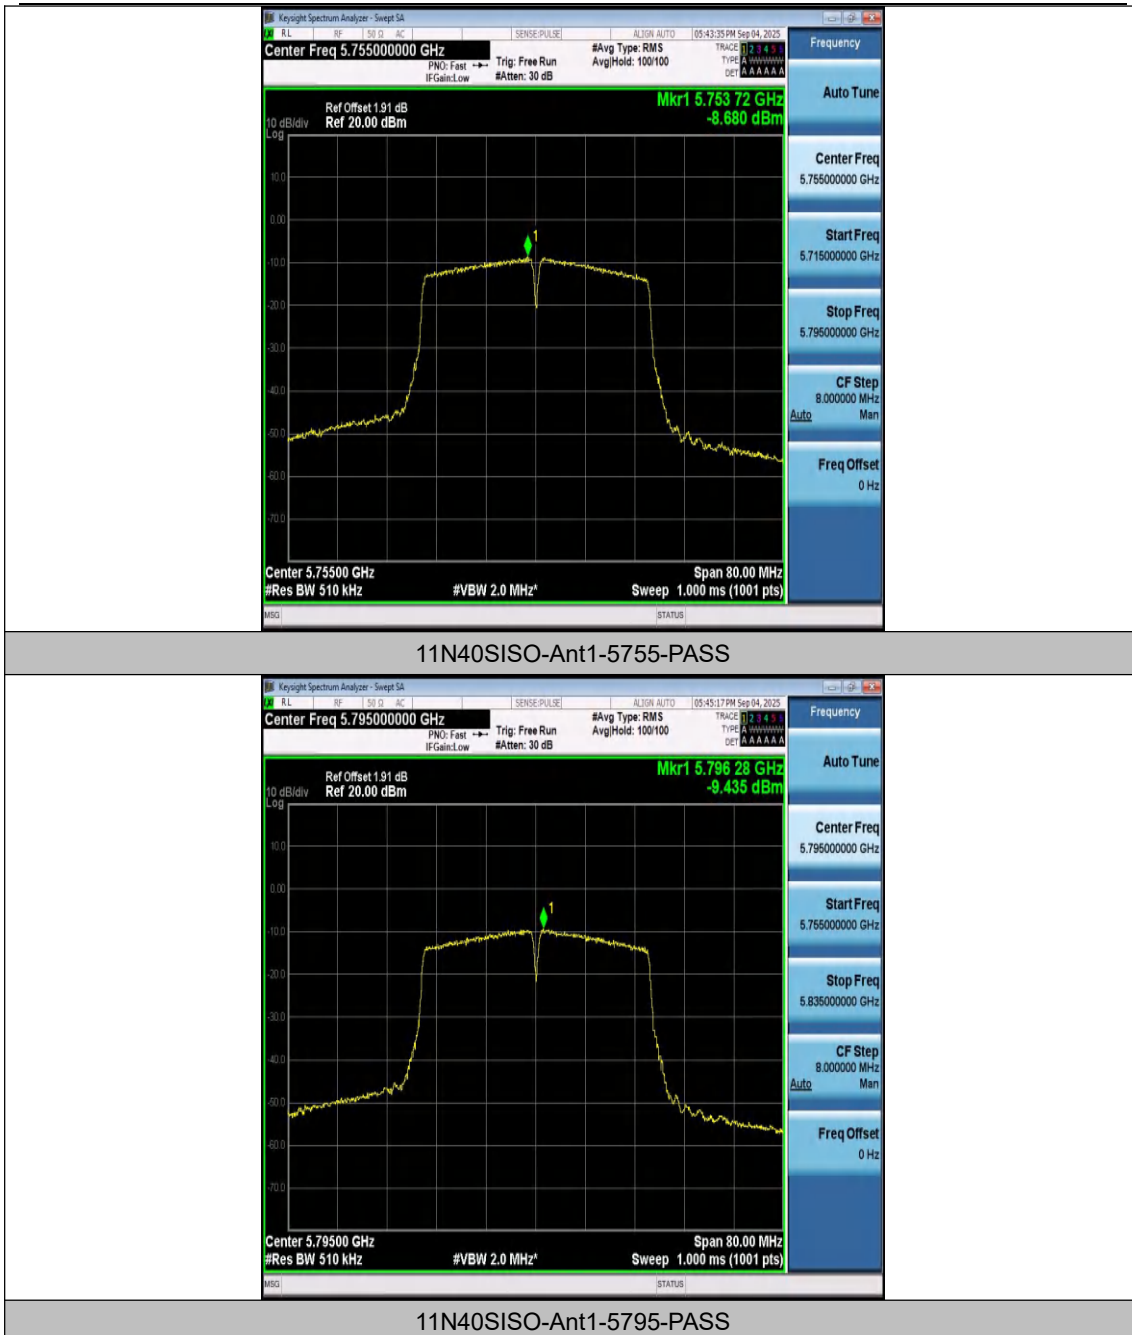

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-40.38	≤-27	PASS
11A	Ant1	High	5240	-42.24	≤-27	PASS
11N20SISO	Ant1	Low	5180	-40.35	≤-27	PASS
11N20SISO	Ant1	High	5240	-43.46	≤-27	PASS
11N40SISO	Ant1	Low	5190	-38.22	≤-27	PASS
11N40SISO	Ant1	High	5230	-43.66	≤-27	PASS


Note: 1.The Antenna gain and cable loss are compensated in the graph.


Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-33.85	≤16.87	PASS
11A	Ant1	Low	5745	5700~5720	-34.32	≤14.76	PASS
11A	Ant1	Low	5745	5650~5700	-43.14	≤-26.10	PASS
11A	Ant1	Low	5745	5645~5650	-43.35	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-40.55	≤17.88	PASS
11A	Ant1	High	5825	5855~5875	-42.36	≤10.78	PASS
11A	Ant1	High	5825	5875~5925	-44.66	≤-26.91	PASS
11A	Ant1	High	5825	5925~5935	-44.74	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-34.41	≤16.87	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-35.87	≤14.40	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-43.83	≤-26.70	PASS
11N20SISO	Ant1	Low	5745	5645~5650	-43.49	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-41.75	≤16.03	PASS
11N20SISO	Ant1	High	5825	5855~5875	-43.39	≤11.00	PASS
11N20SISO	Ant1	High	5825	5875~5925	-44.53	≤-26.21	PASS
11N20SISO	Ant1	High	5825	5925~5935	-44.47	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-32.68	≤15.74	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-31.61	≤14.44	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-43.9	≤-26.80	PASS
11N40SISO	Ant1	Low	5755	5645~5650	-42.95	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-43.57	≤16.41	PASS
11N40SISO	Ant1	High	5795	5855~5875	-43.65	≤10.62	PASS
11N40SISO	Ant1	High	5795	5875~5925	-45.21	≤-26.83	PASS
11N40SISO	Ant1	High	5795	5925~5935	-44.84	≤-27	PASS

Note: 1.The Antenna gain and cable loss are compensated in the graph.

Test Graphs B1

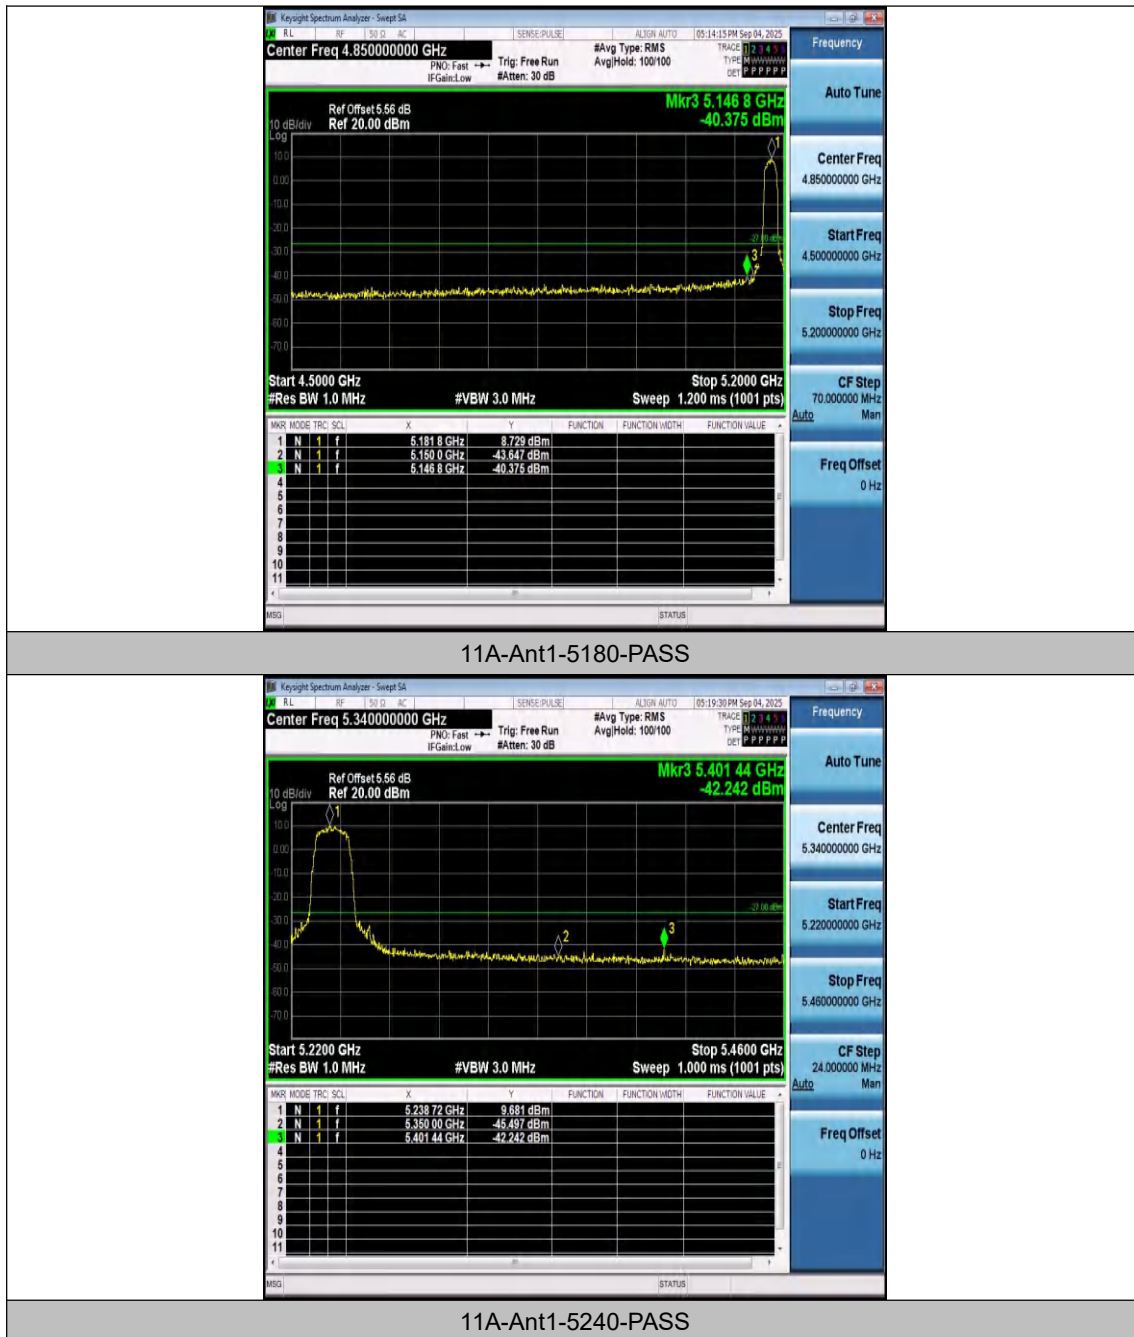


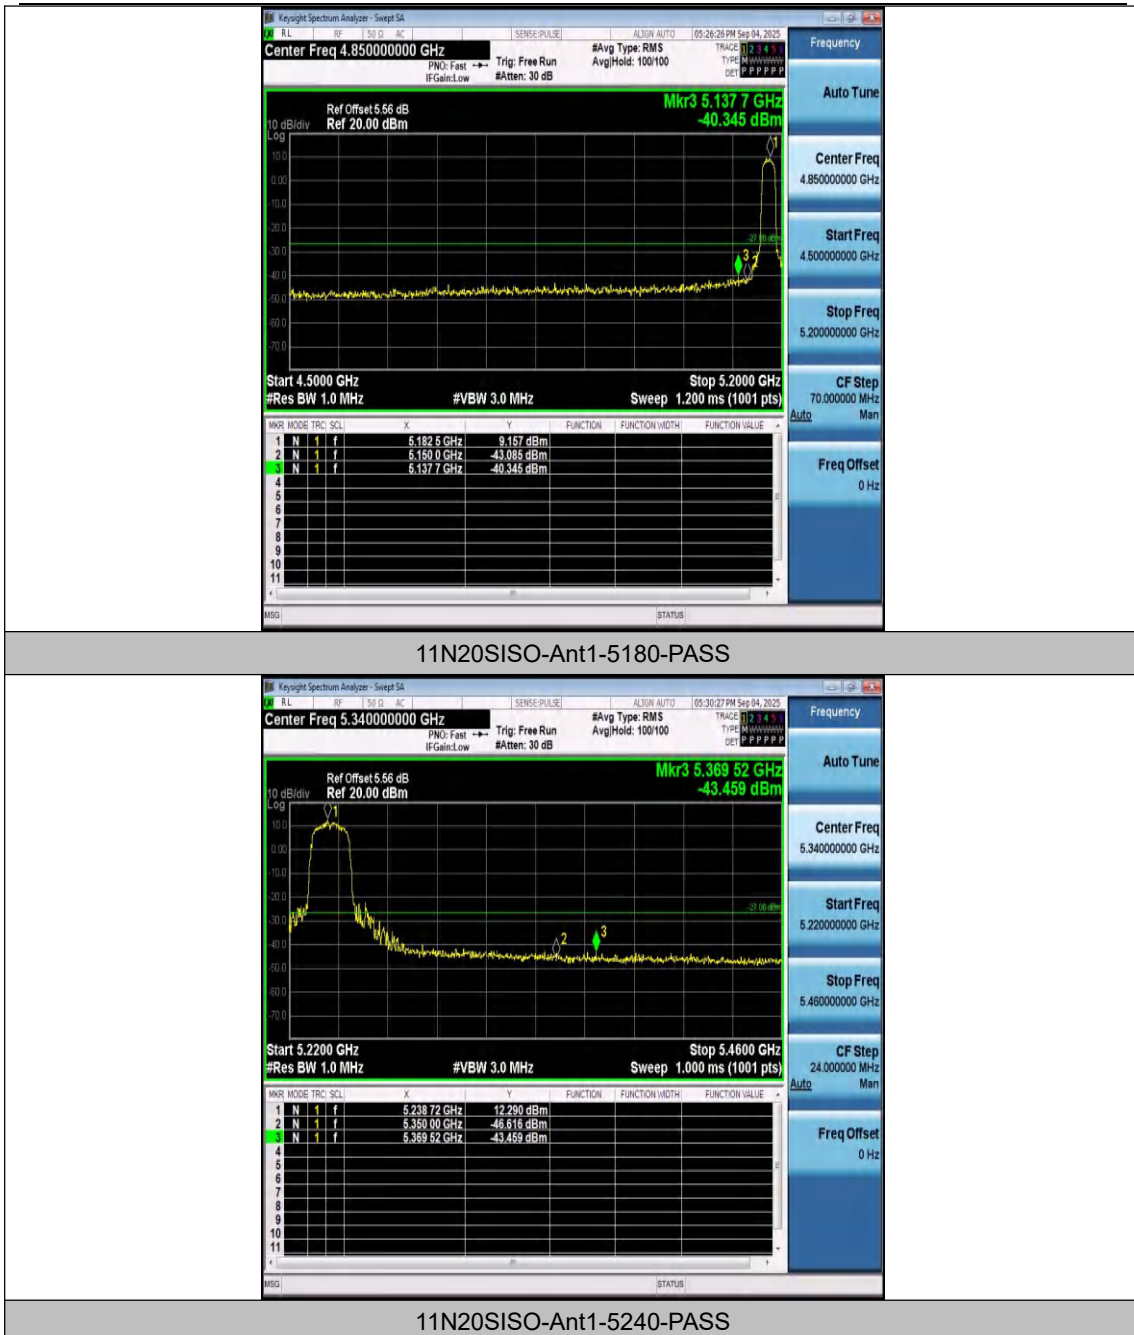

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

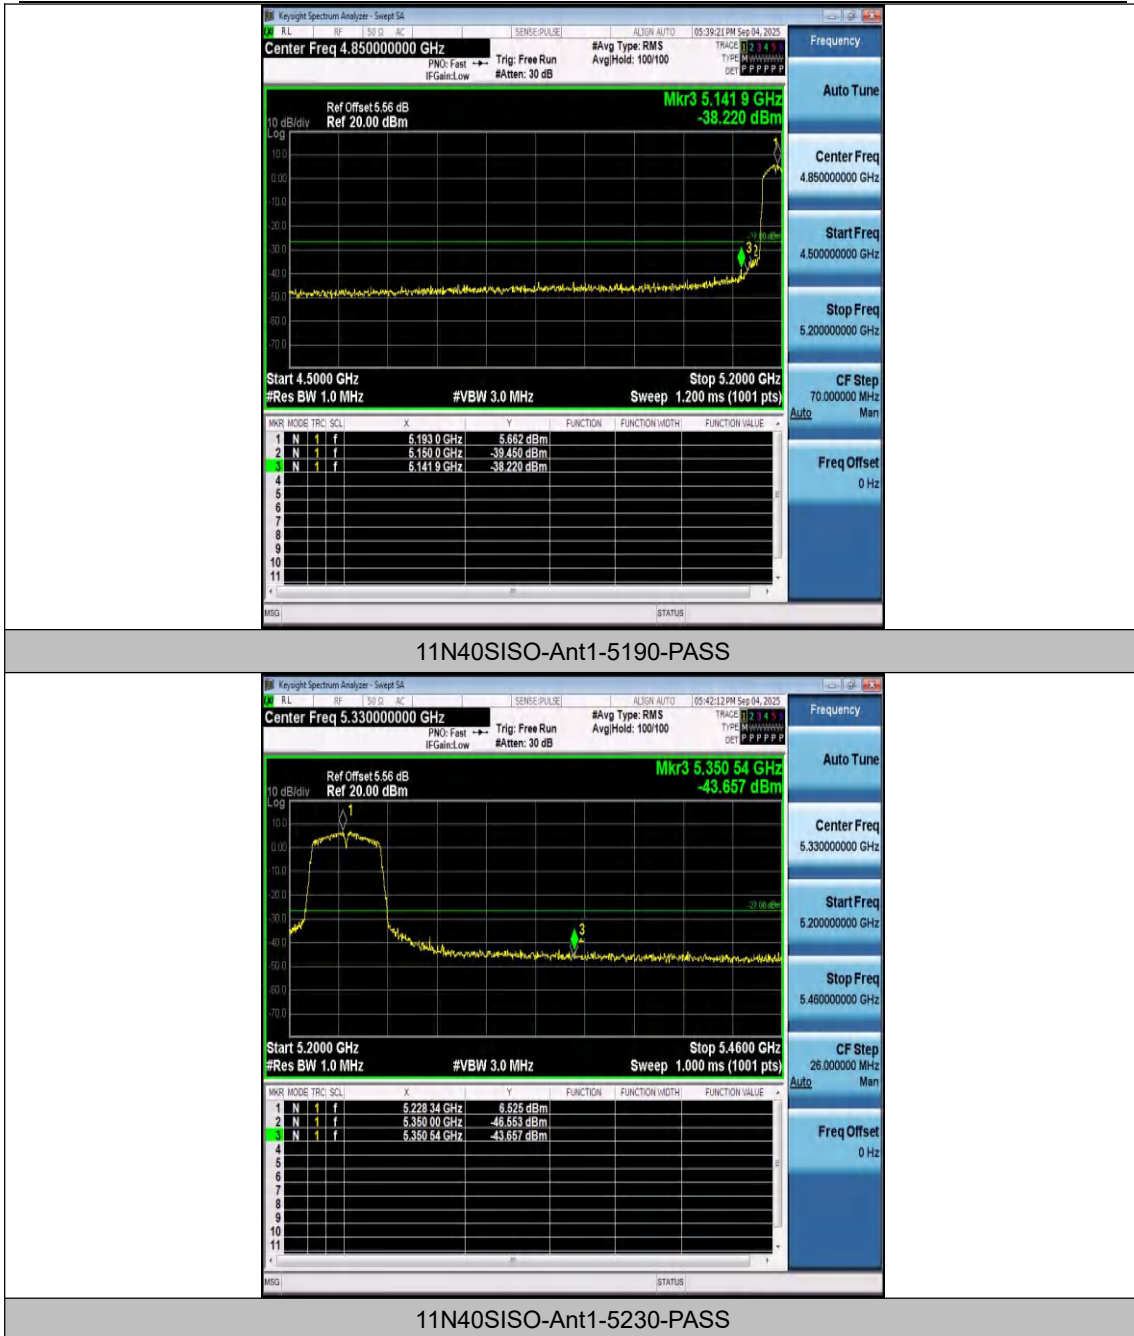



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs B4

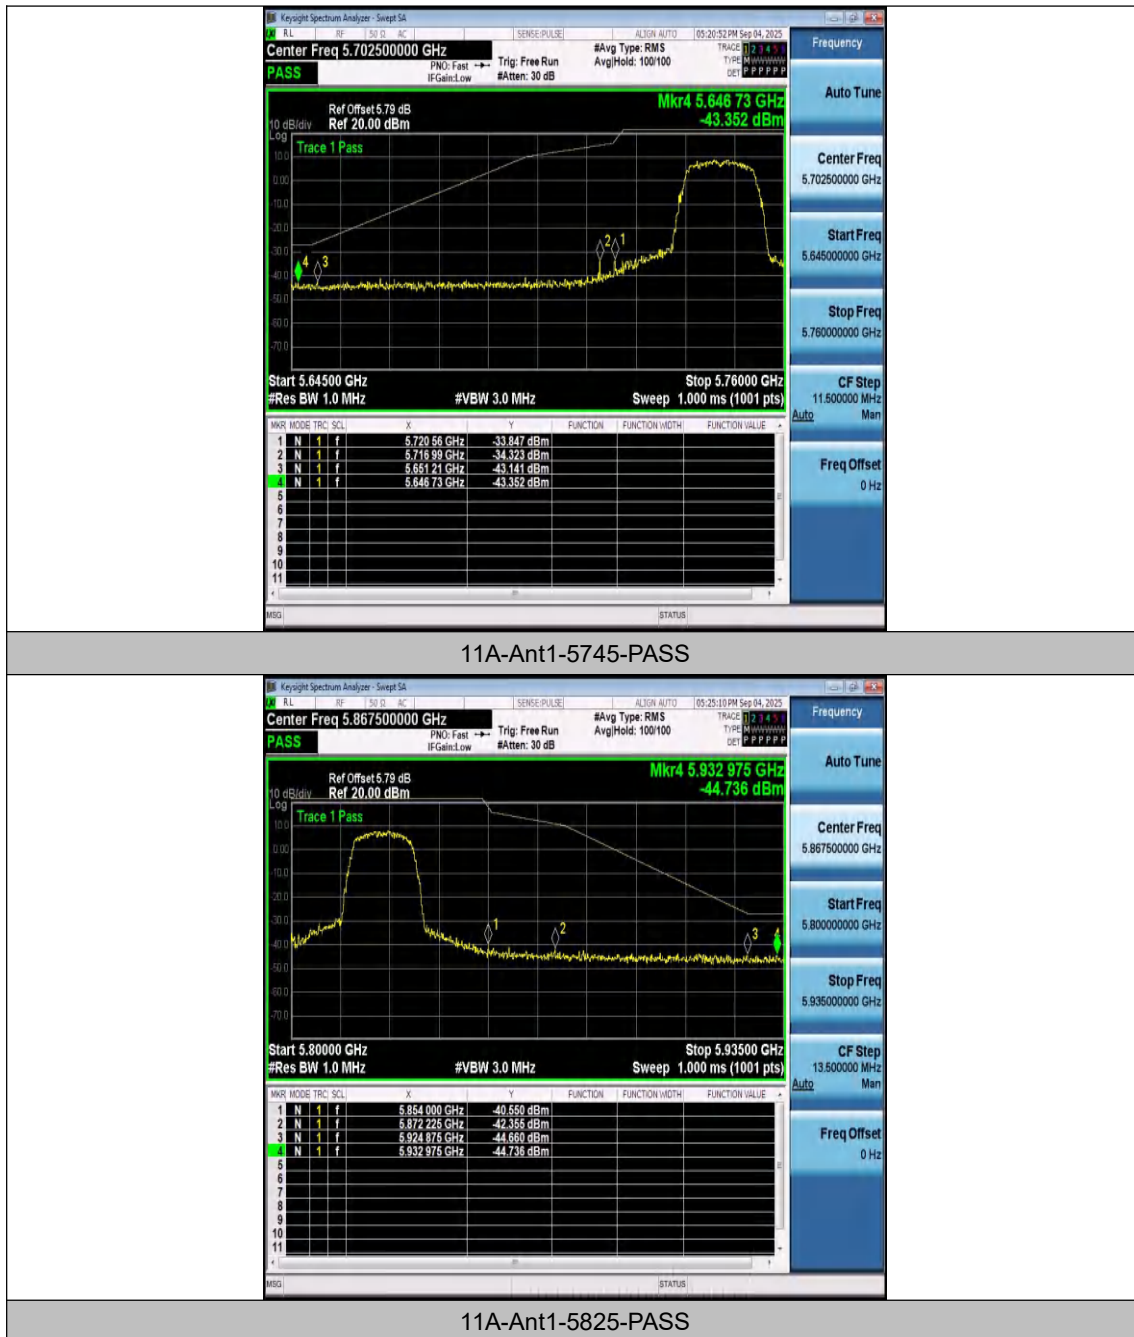

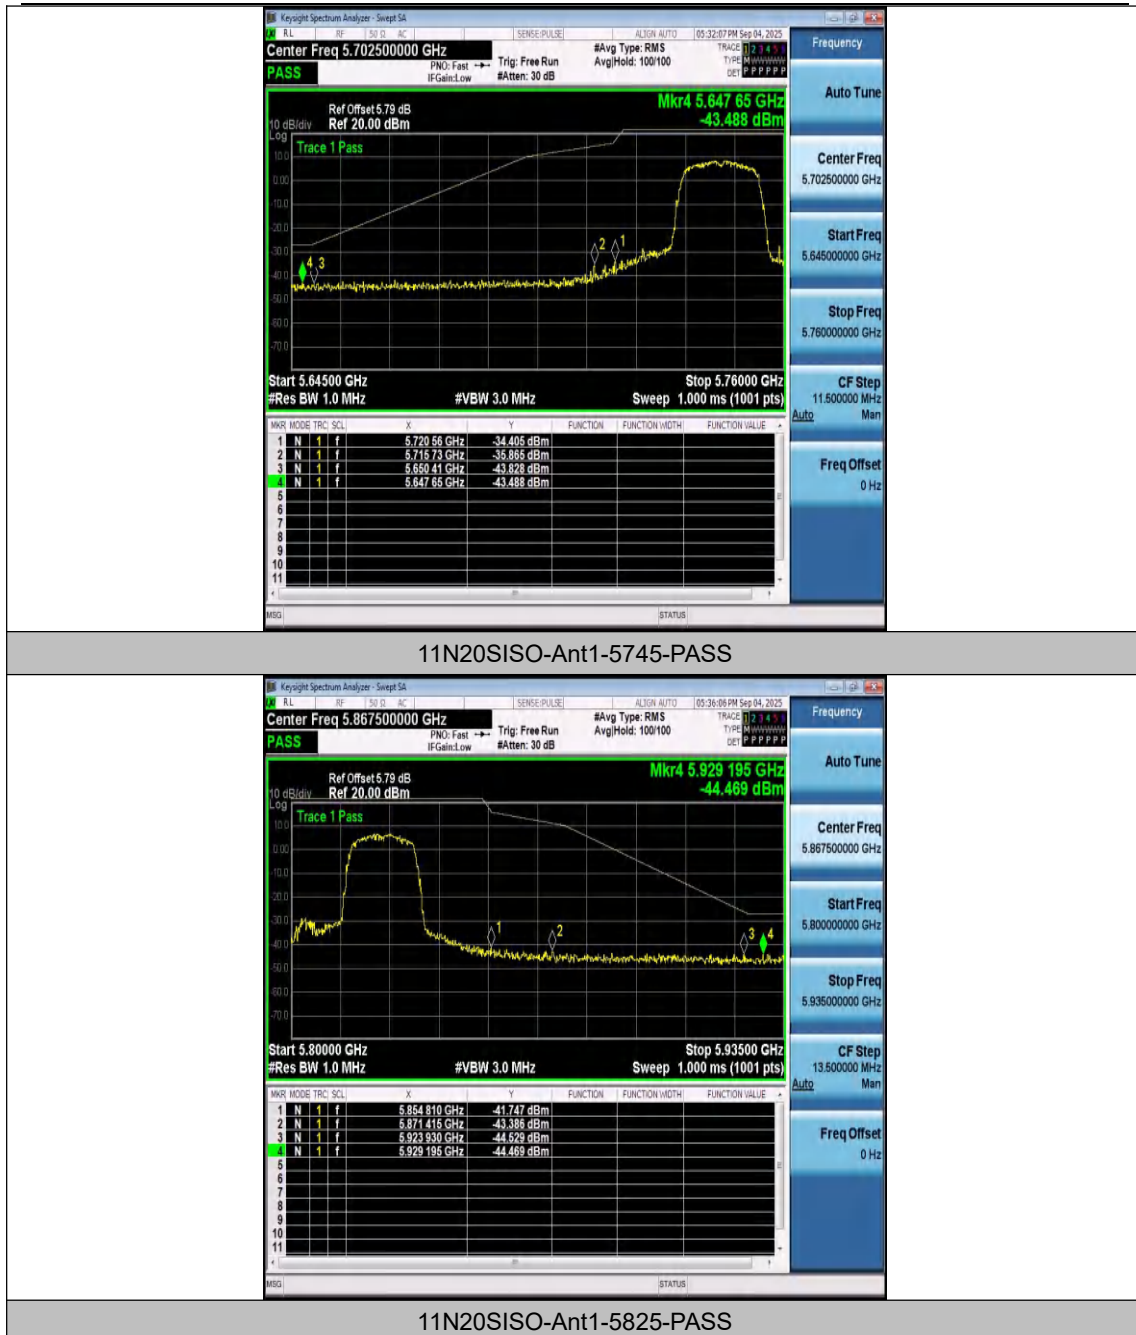

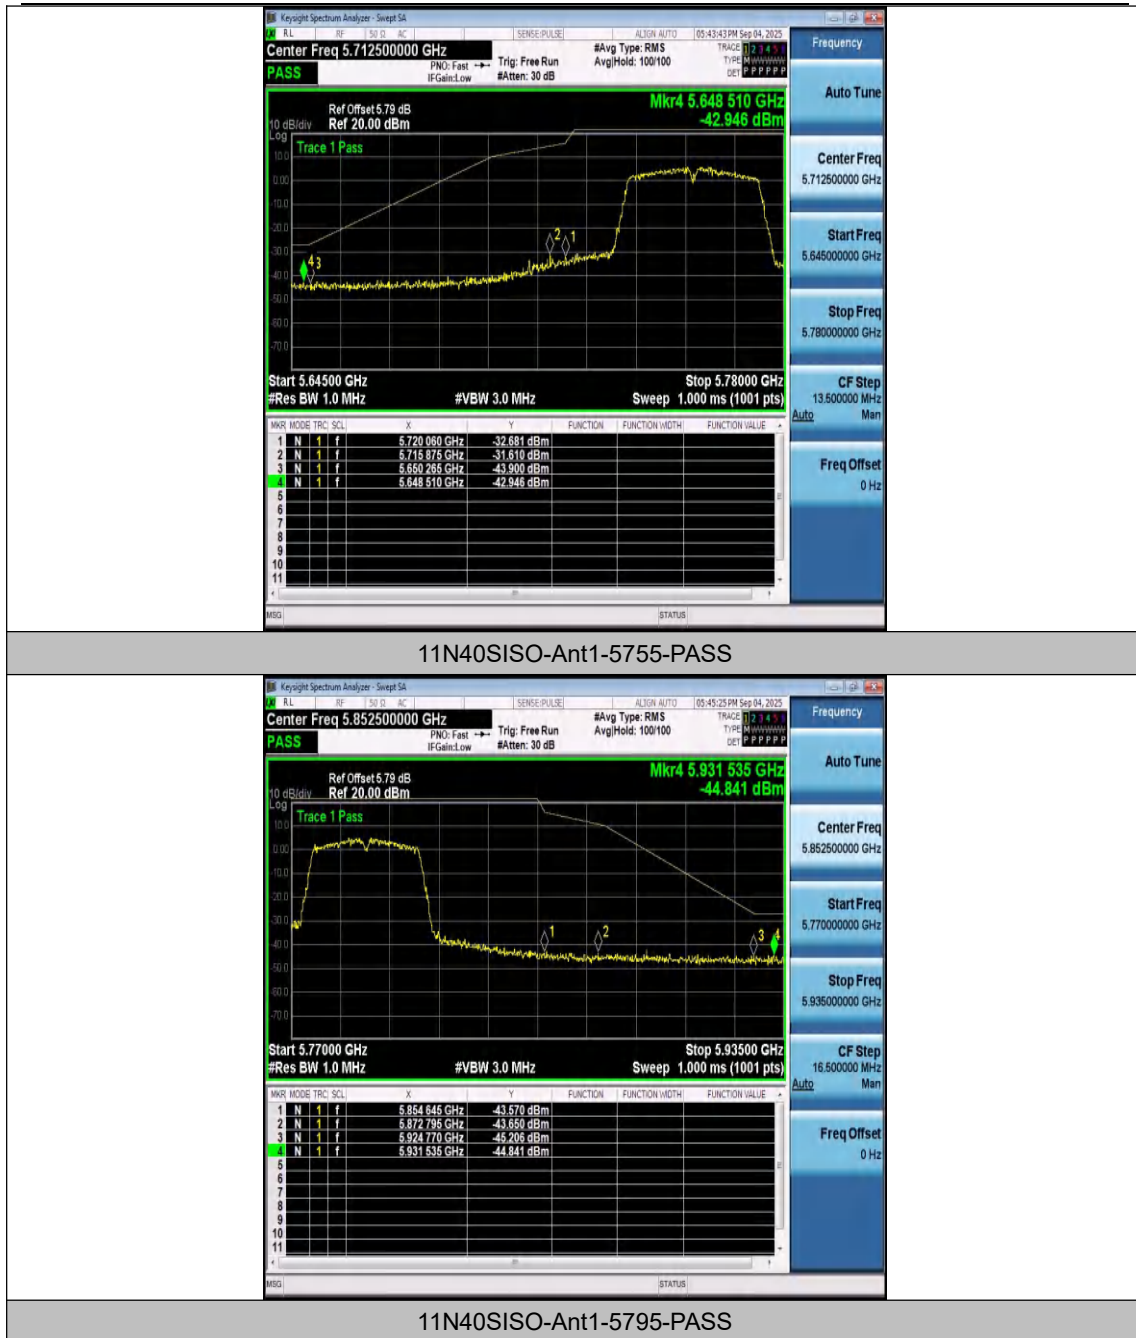

---END---